

# REPORT OF 040304

1. [Introduction](#)
2. [Summary](#)
  - [Instrument Unavailability](#)
  - [Browse Visual Inspection](#)
  - [Module Stepping Results](#)
  - [Data Analysis](#)
3. [Module Stepping](#)
4. [Internal Calibration pulses](#)
  - [Daily statistics \(row 3 and 24\)](#)
  - [Cyclic statistics \(row 3 and 24\)](#)
  - [cal pulses monitoring \(all rows\)](#)
5. [Raw Data Statistics](#)
  - [raw data mean I and Q](#)
  - [raw data stdev I and Q](#)
  - [raw gain imbalance](#)
6. [Wave Doppler analysis](#)
  - [Unbiased Doppler Error](#)
  - [Absolute Doppler](#)
  - [Doppler evolution versus ANX](#)

## 1 - Introduction

This report is based on the analysis of wave mode level-1 cross spectra (ASA\_WVS\_1P) products, which are the available few hours after the acquisition, on the high rate browse (BP) products and on the Module Stepping (MS) product.

## 2 - Summary

### 2.1 - Instrument Unavailability

Antenna reset on 03-MAR-2004 10:00:57 to 10:06:51 due to out of limit temperatures detected on tile D2.

### 2.2 - Browse Visual Inspection

No anomalies observed on available browse products

### 2.3 - Data Analysis

- Stable wave internal calibration pulses gain and phase.
- Stable raw data statistics.

-Nominal Doppler behavior.

### 3 - Module Stepping Mode

The MS mode provides an internal health check on an individual module basis. The purpose of this mode is to identify any malfunctioning modules and to identify modules for which calibration offsets are to be applied.

No anomalies observed on available MS products:

Polarisation	Start Time
V	20040302 194817
H	20040302 194657

#### MSM in V/V polarisation

Pre-launch Reference	DDS-B (2003-06-12) reference
<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/>	<input type="checkbox"/>

#### MSM in H/H polarisation

Pre-launch Reference	DDS-B (2003-06-12) reference
<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/>	<input type="checkbox"/>

### 4 - Internal calibration Results

No anomalies observed.

#### 4.1 - Daily statistics

## 4.2 - Cyclic statistics



## 4.3 - cal pulses monitoring (all rows)



## 5 - RAW data statistics

No anomalies observed.

### 5.1 - Input mean I/Q

channel	stat	DSS-B
MEAN I	mean	0.000454846
	stdev	2.56802e-07
MEAN Q	mean	0.000437556
	stdev	2.96440e-07



### 5.2 - Input stdev I/Q

channel	stat	DSS-B
STDEV I	mean	0.123796
	stdev	0.00123320
STDEV Q	mean	0.124027
	stdev	0.00124676



### 5.3 - Gain imbalance I/Q



## 6 - Wave Doppler Analysis

Preliminary report. The data is not yet controlled

### 6.1 - Unbiased Doppler Error

Evolution of unbiased Doppler error (Real - Expected)

Ascending

Descending

### 6.2 - Absolute Doppler

Evolution of Absolute Doppler

Ascending


Descending

### 6.3 - Doppler evolution versus ANX


Evolution Doppler error versus ANX




Average P1

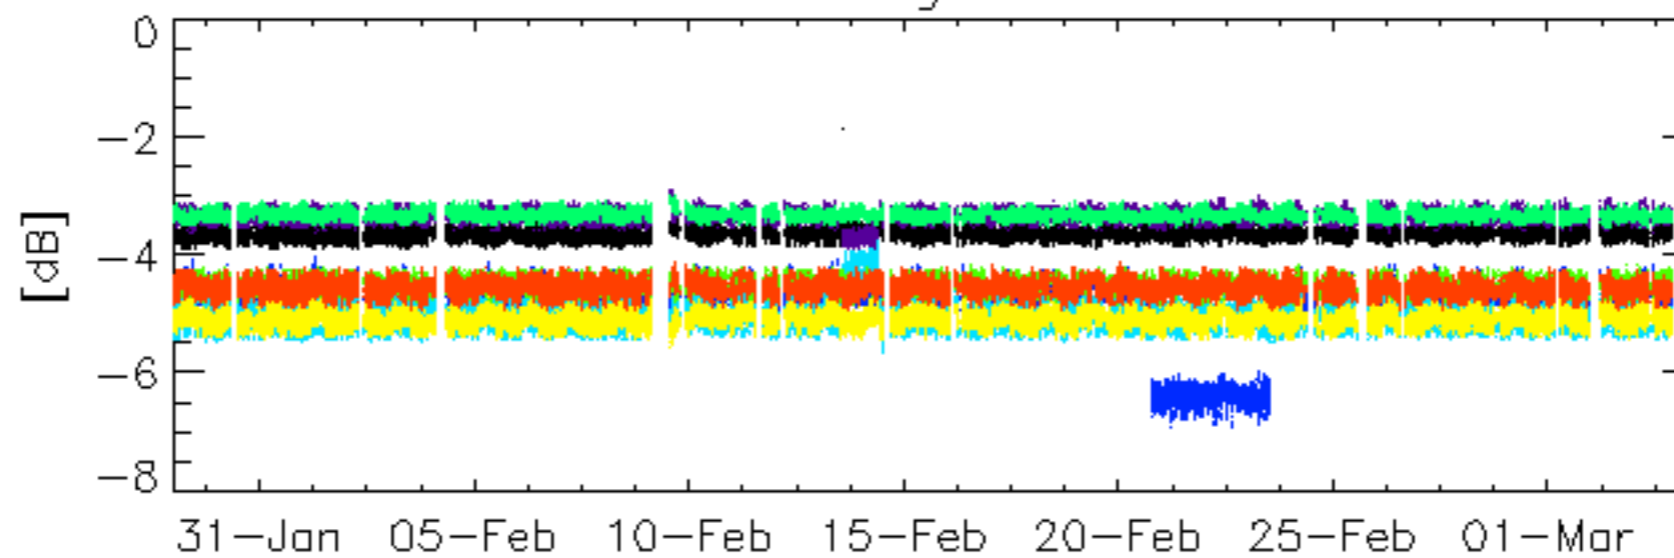


Average p2

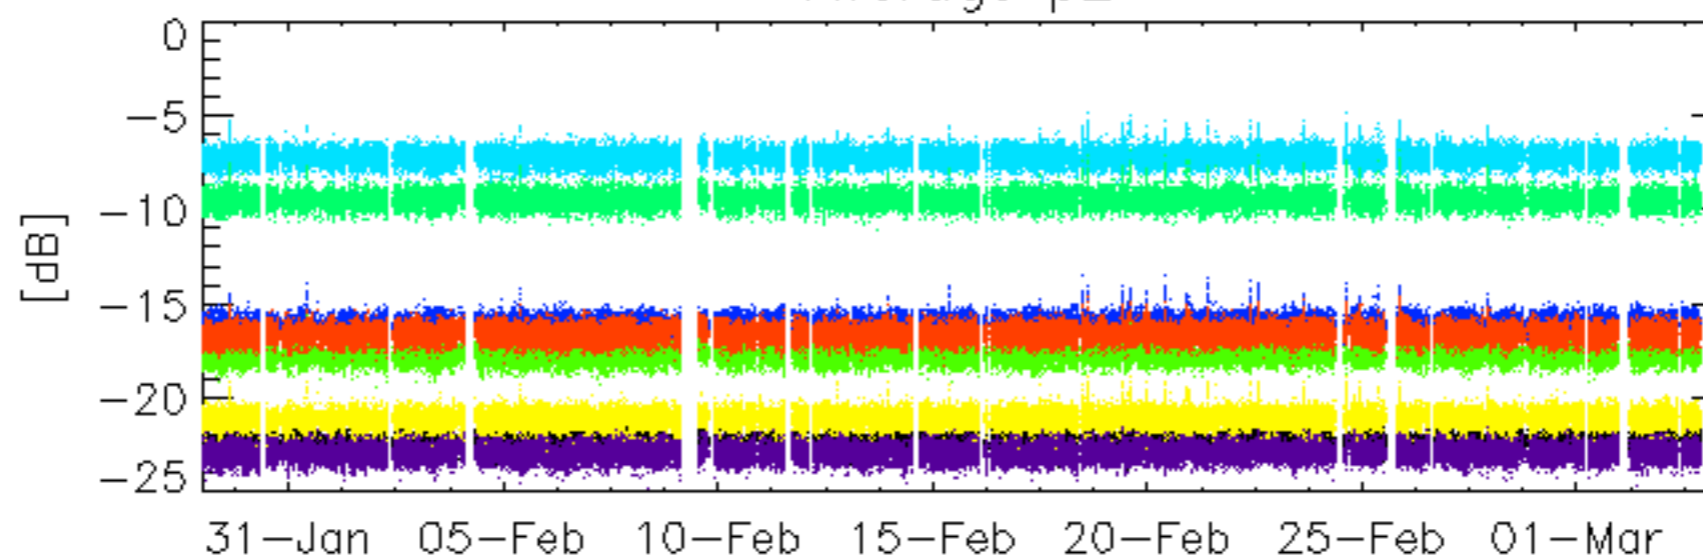


Average p3

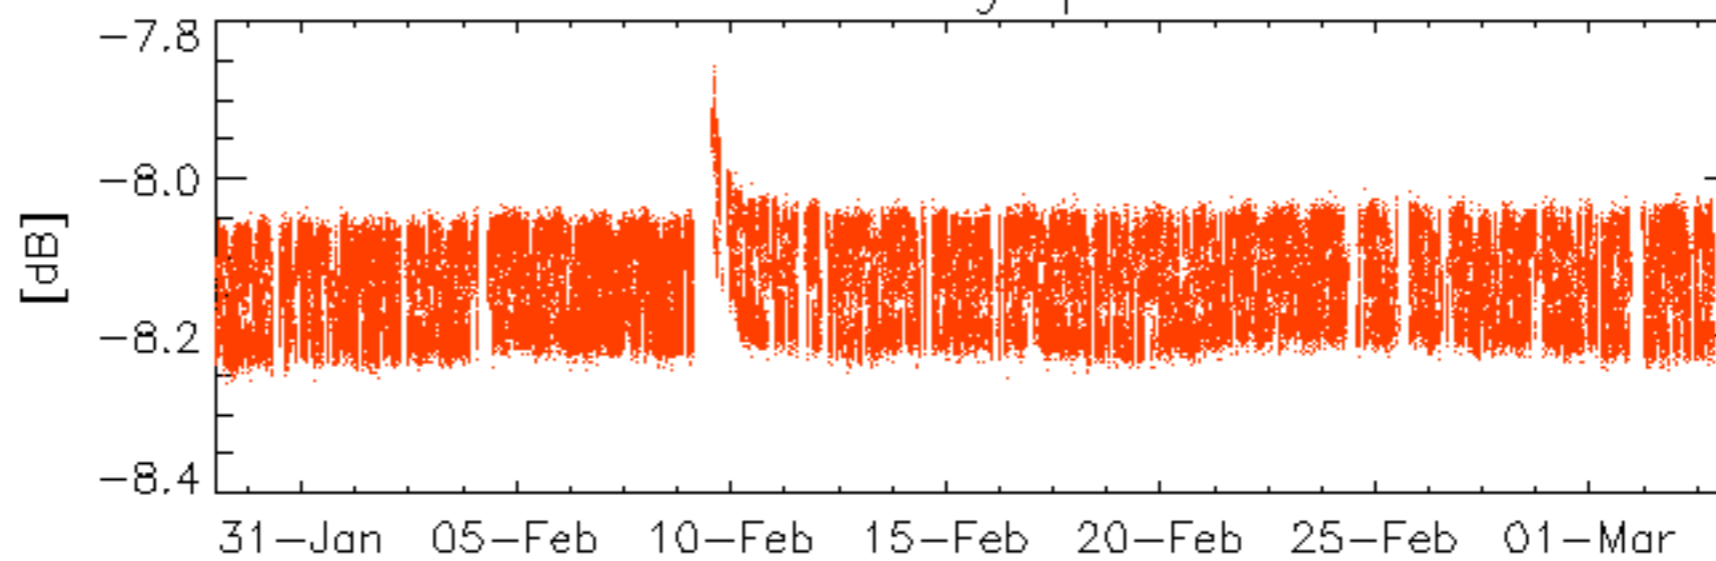


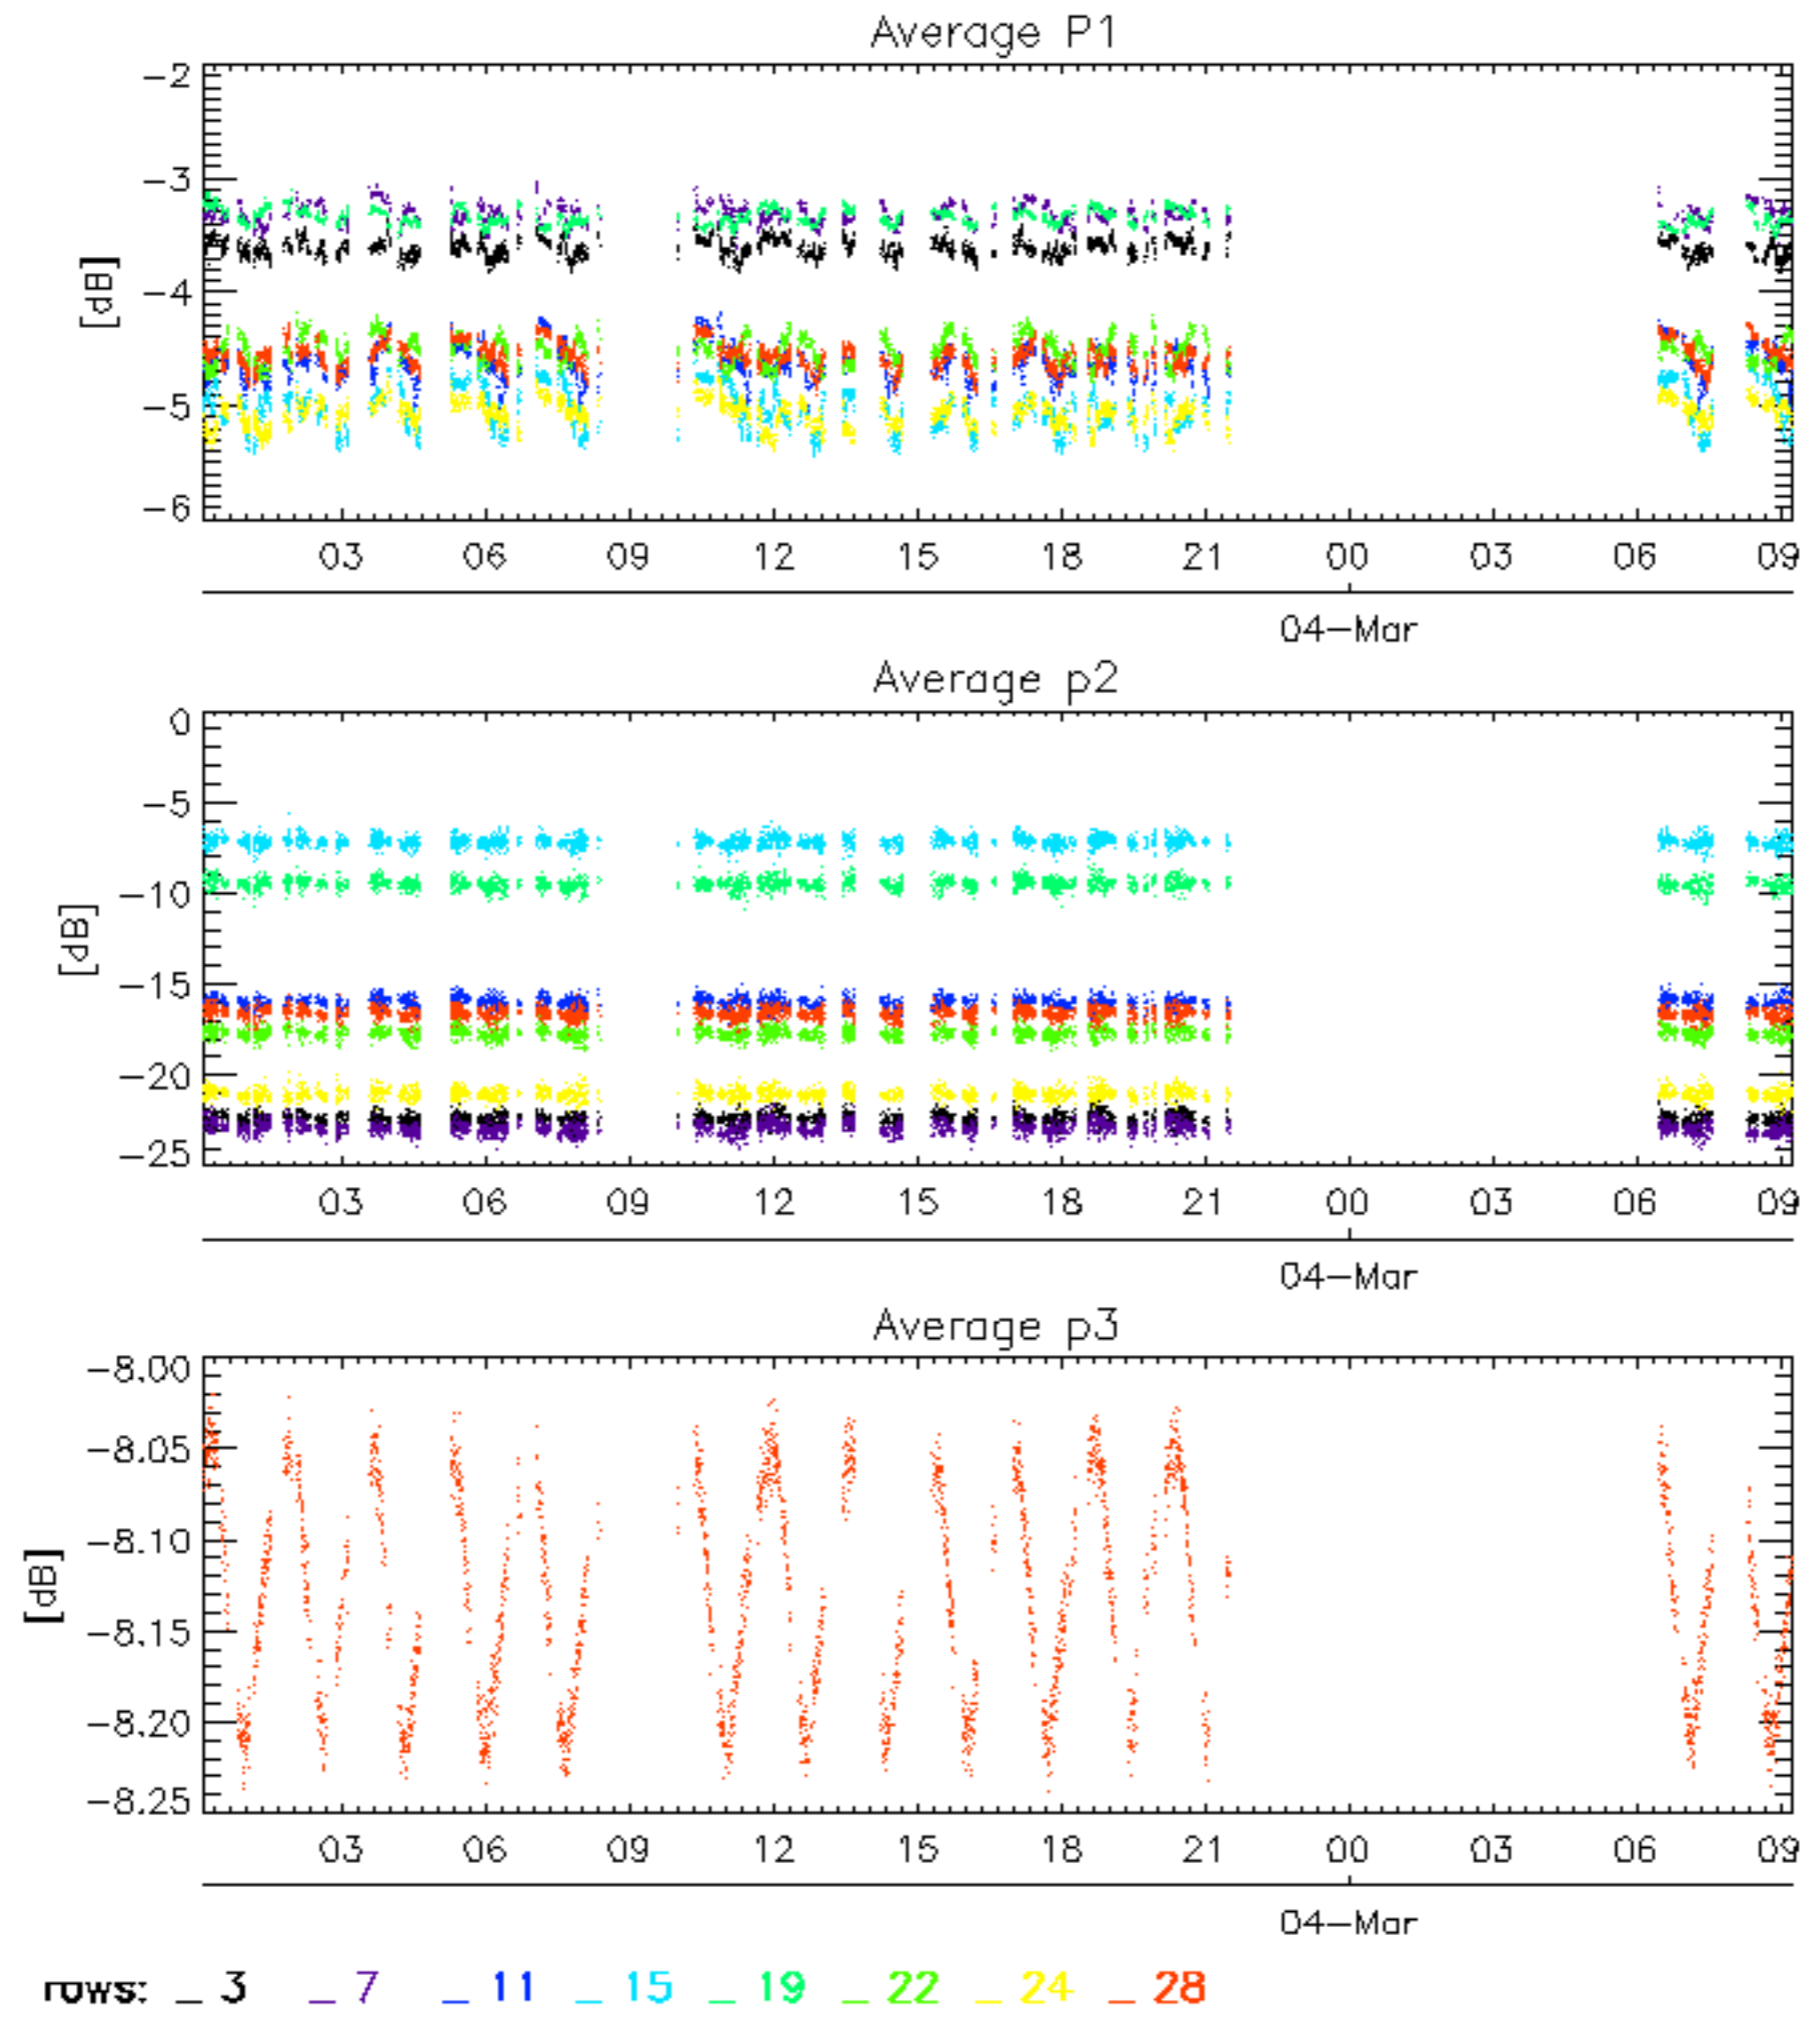


Average P1 (row 3 & row 24)

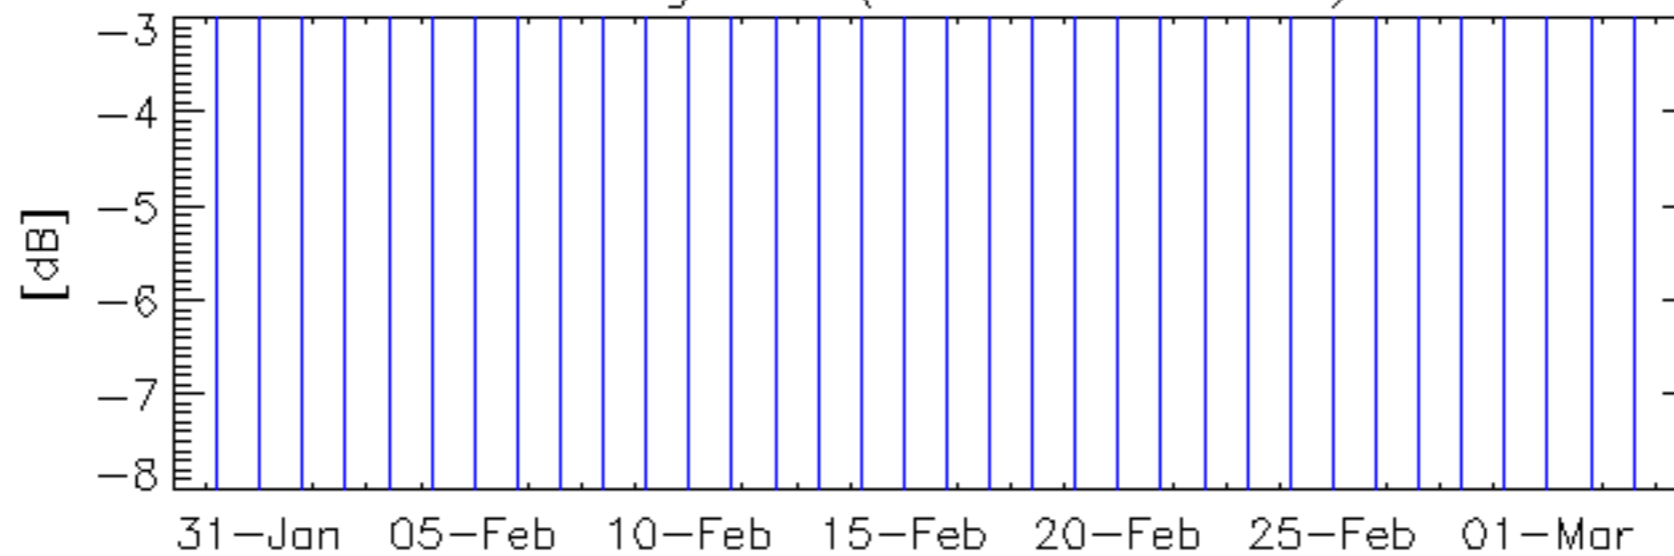


Average P2

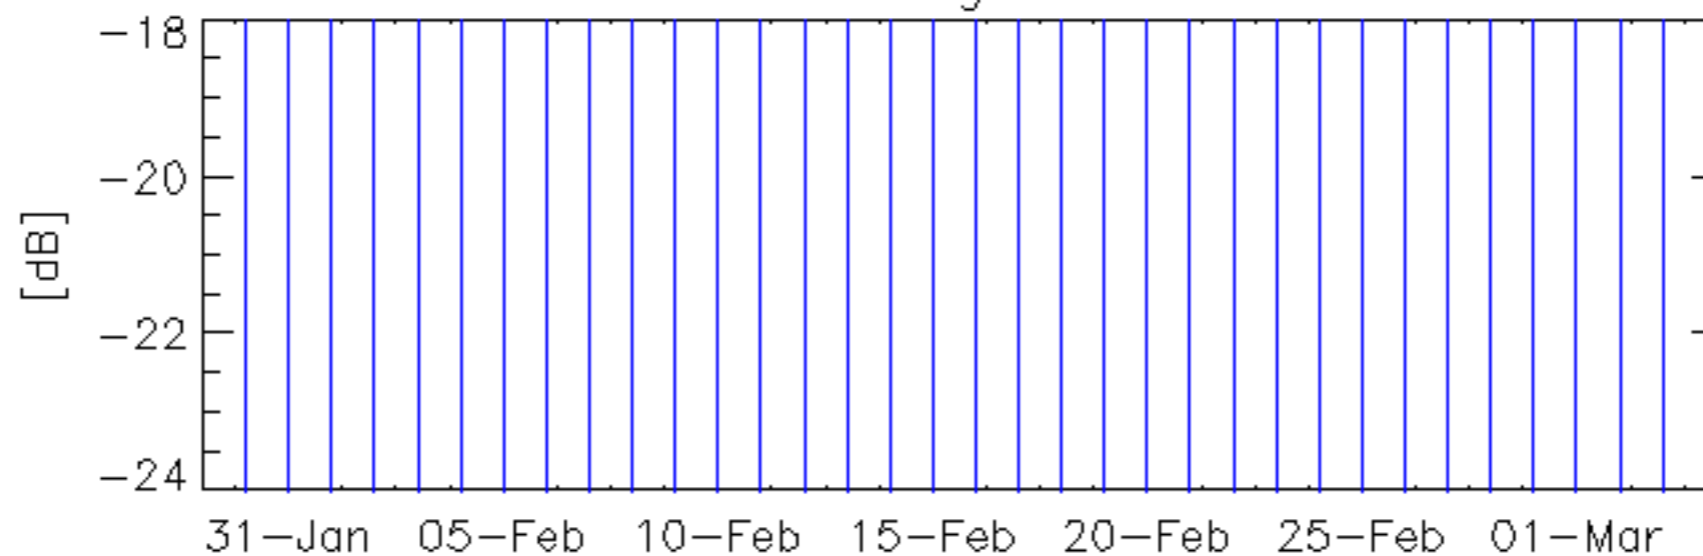


Average P3

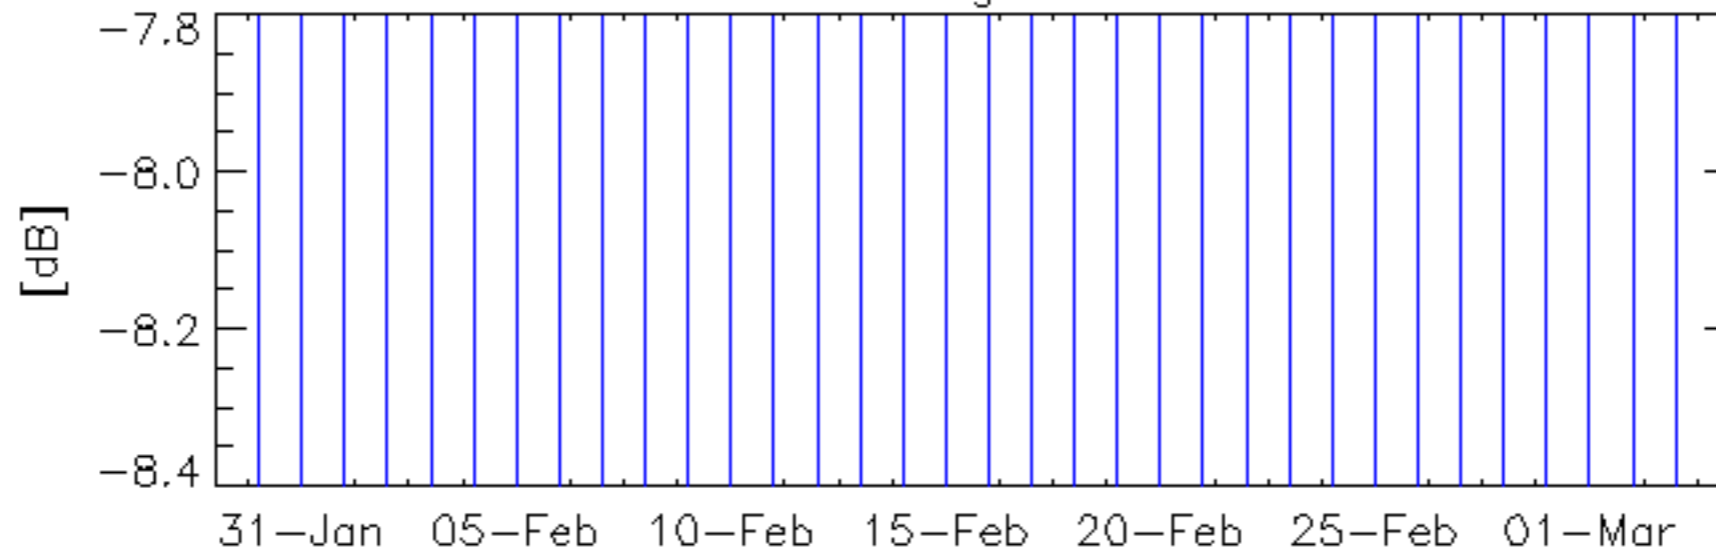


Average P1 (row 3 & row 24)

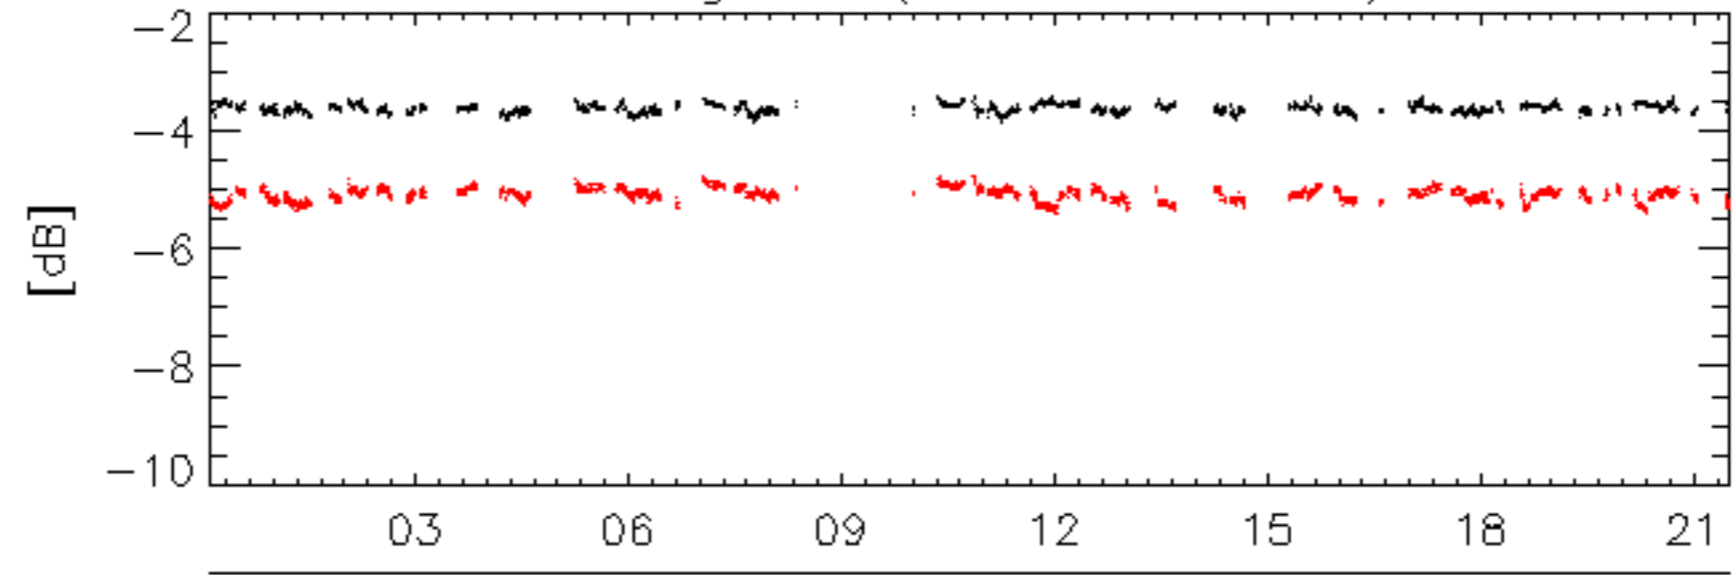

03-Mar  
Average P2

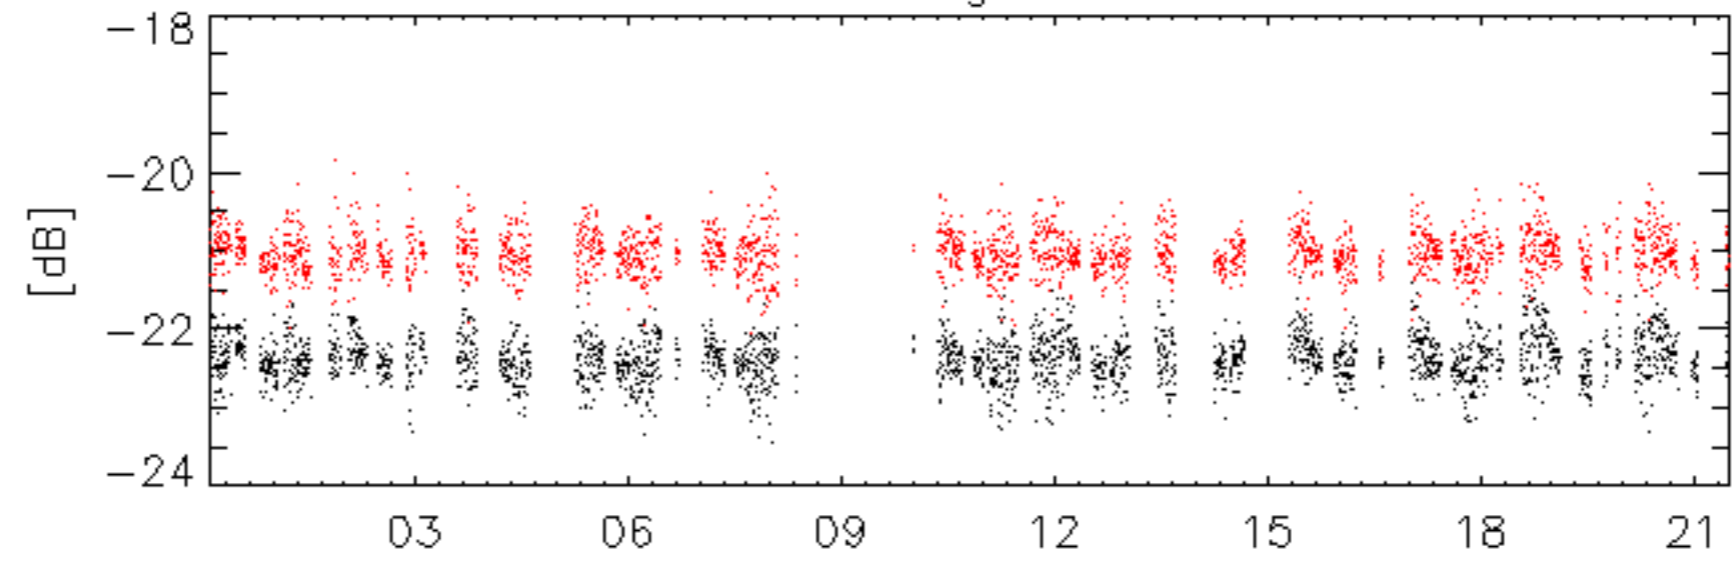

03-Mar  
Average P3

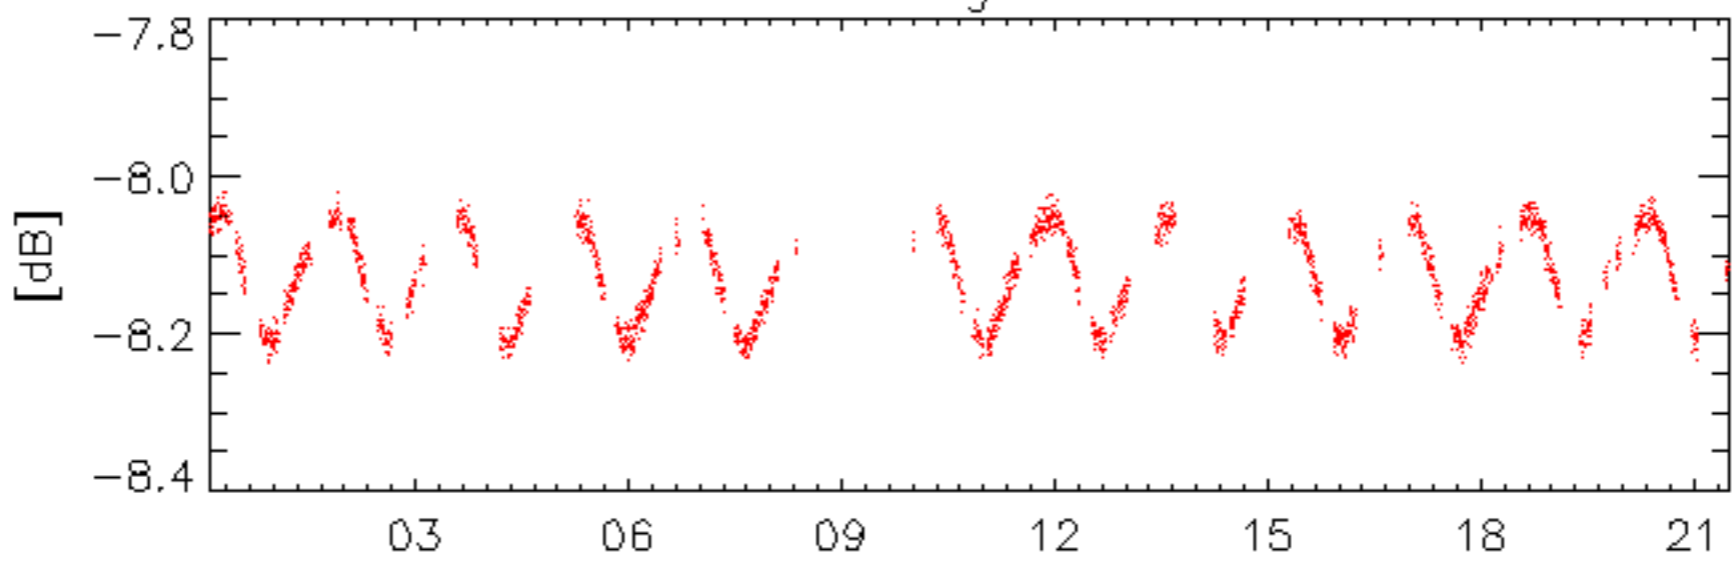


03-Mar



No anomalies observed on available browse products

No anomalies observed.

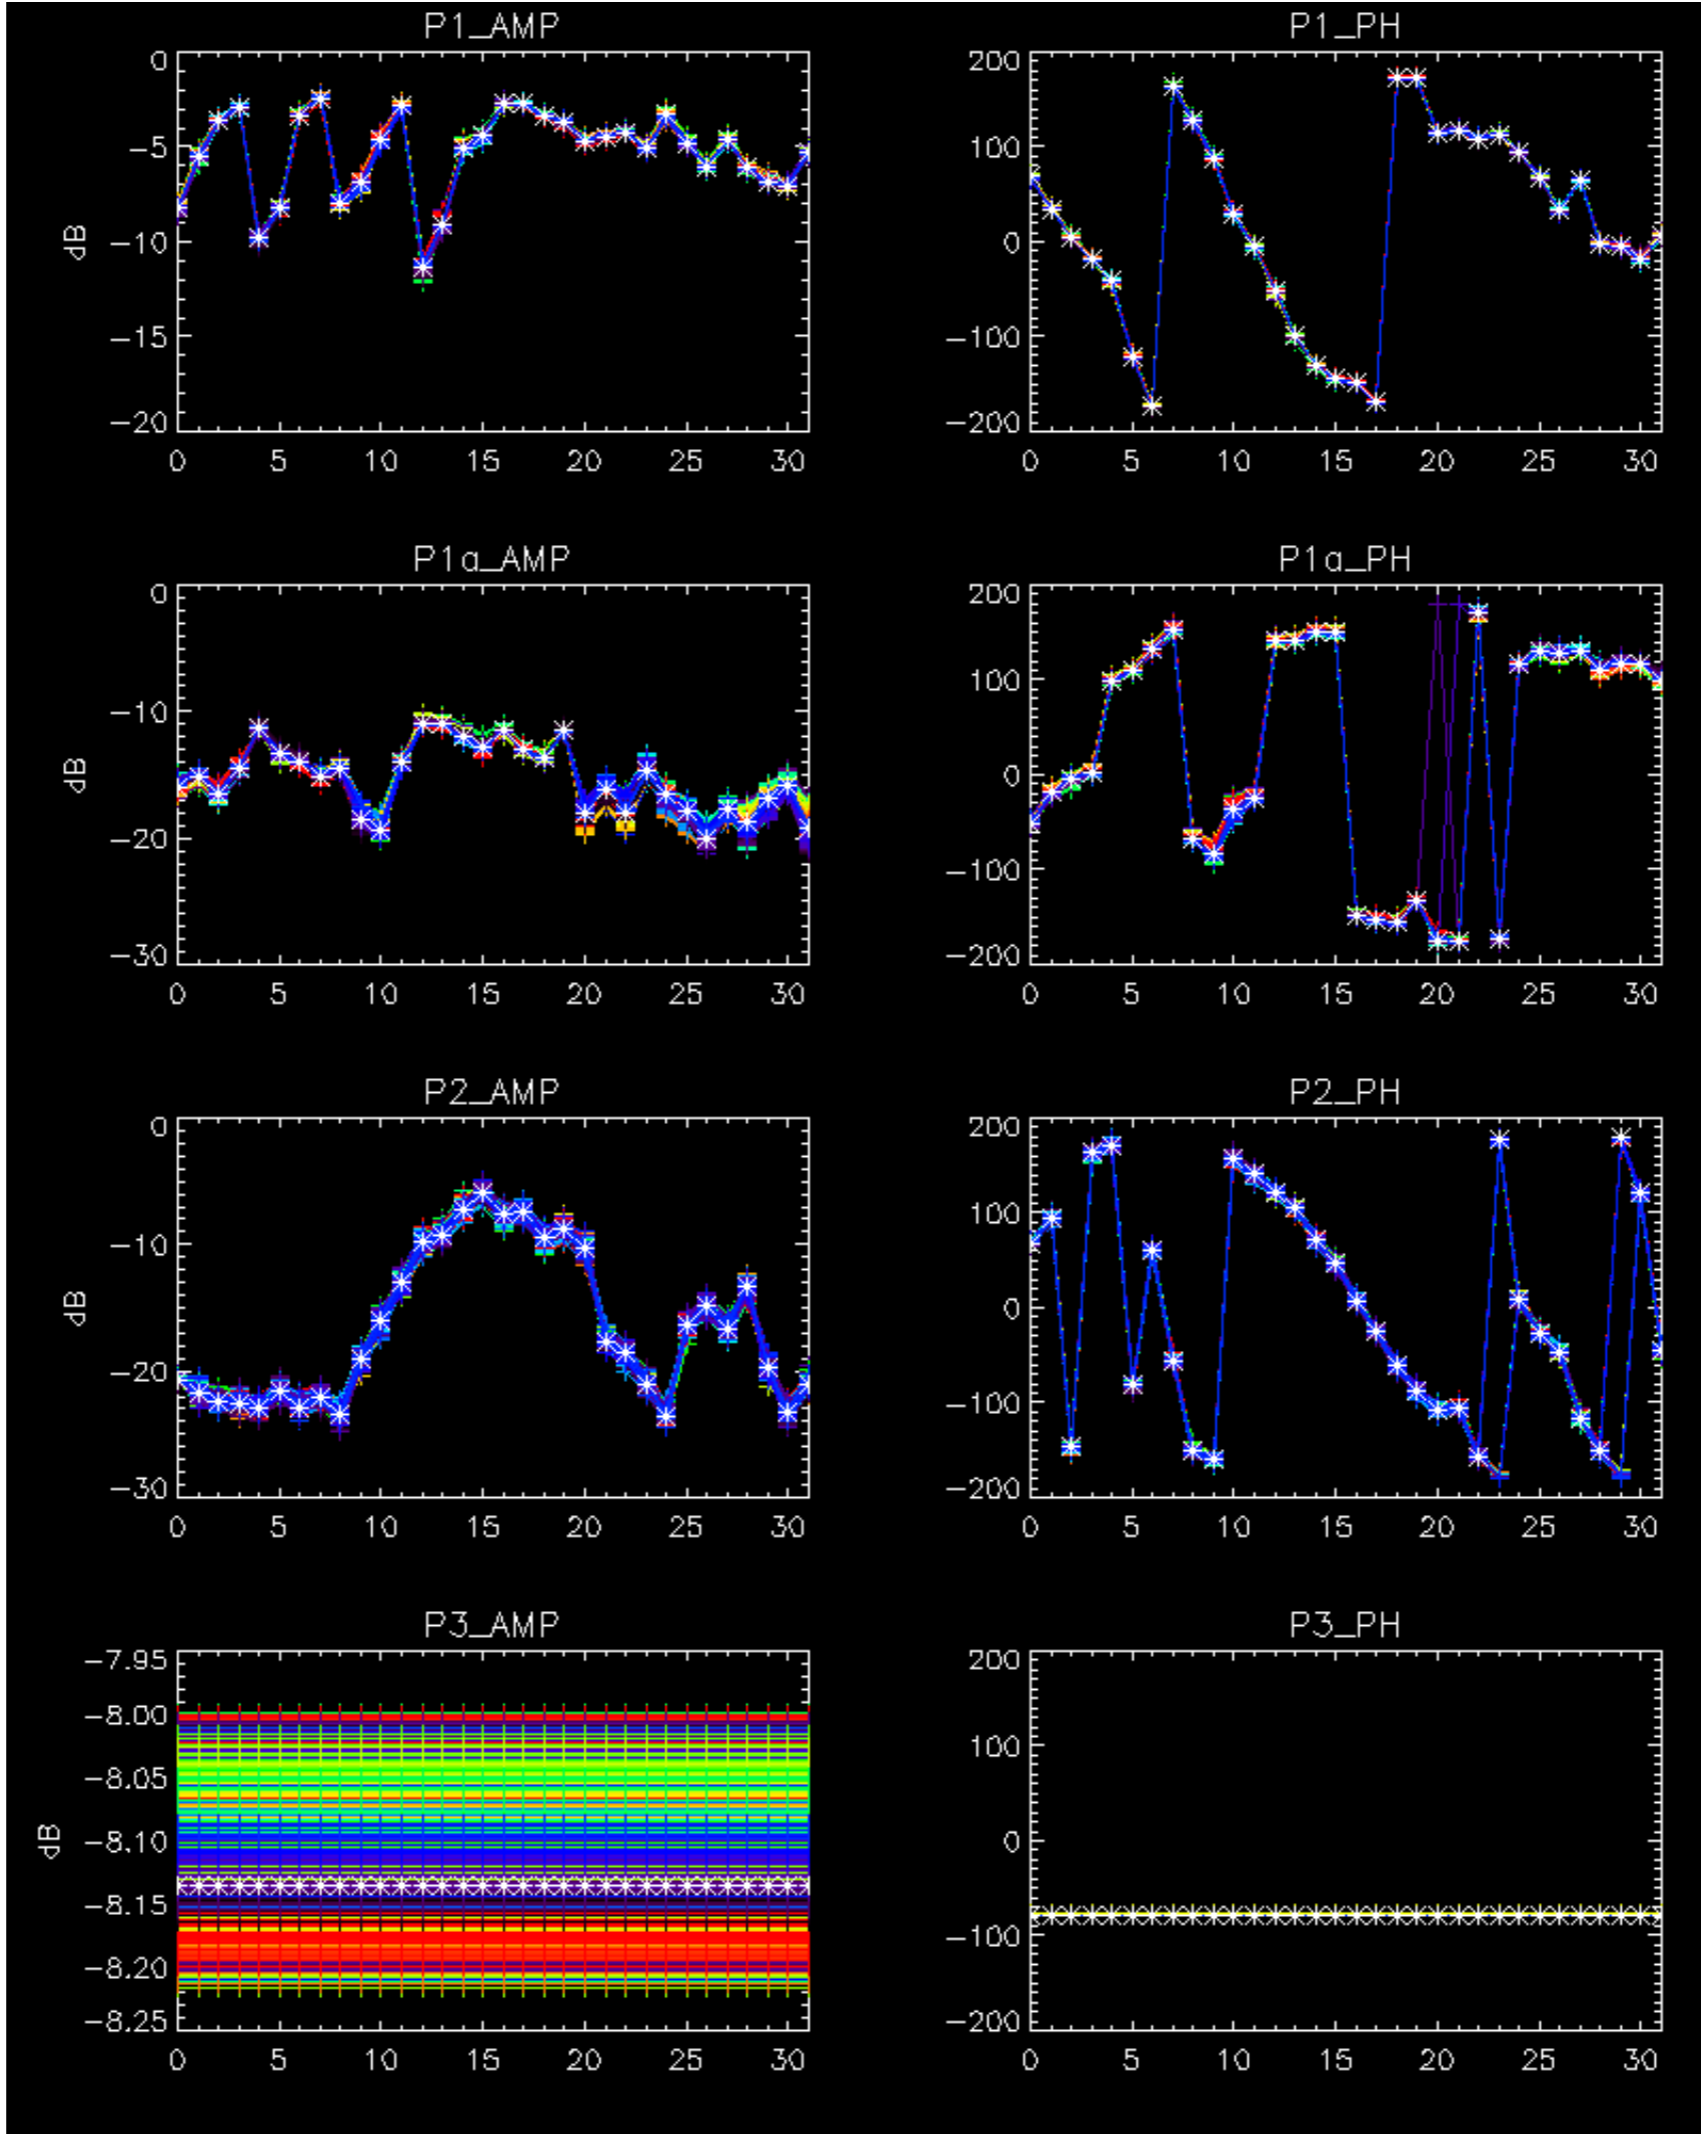


- Stable wave internal calibration pulses gain and phase.
- Stable raw data statistics.
- Nominal Doppler behavior.






Doppler 'WVS' 'IS2' 'H/H'


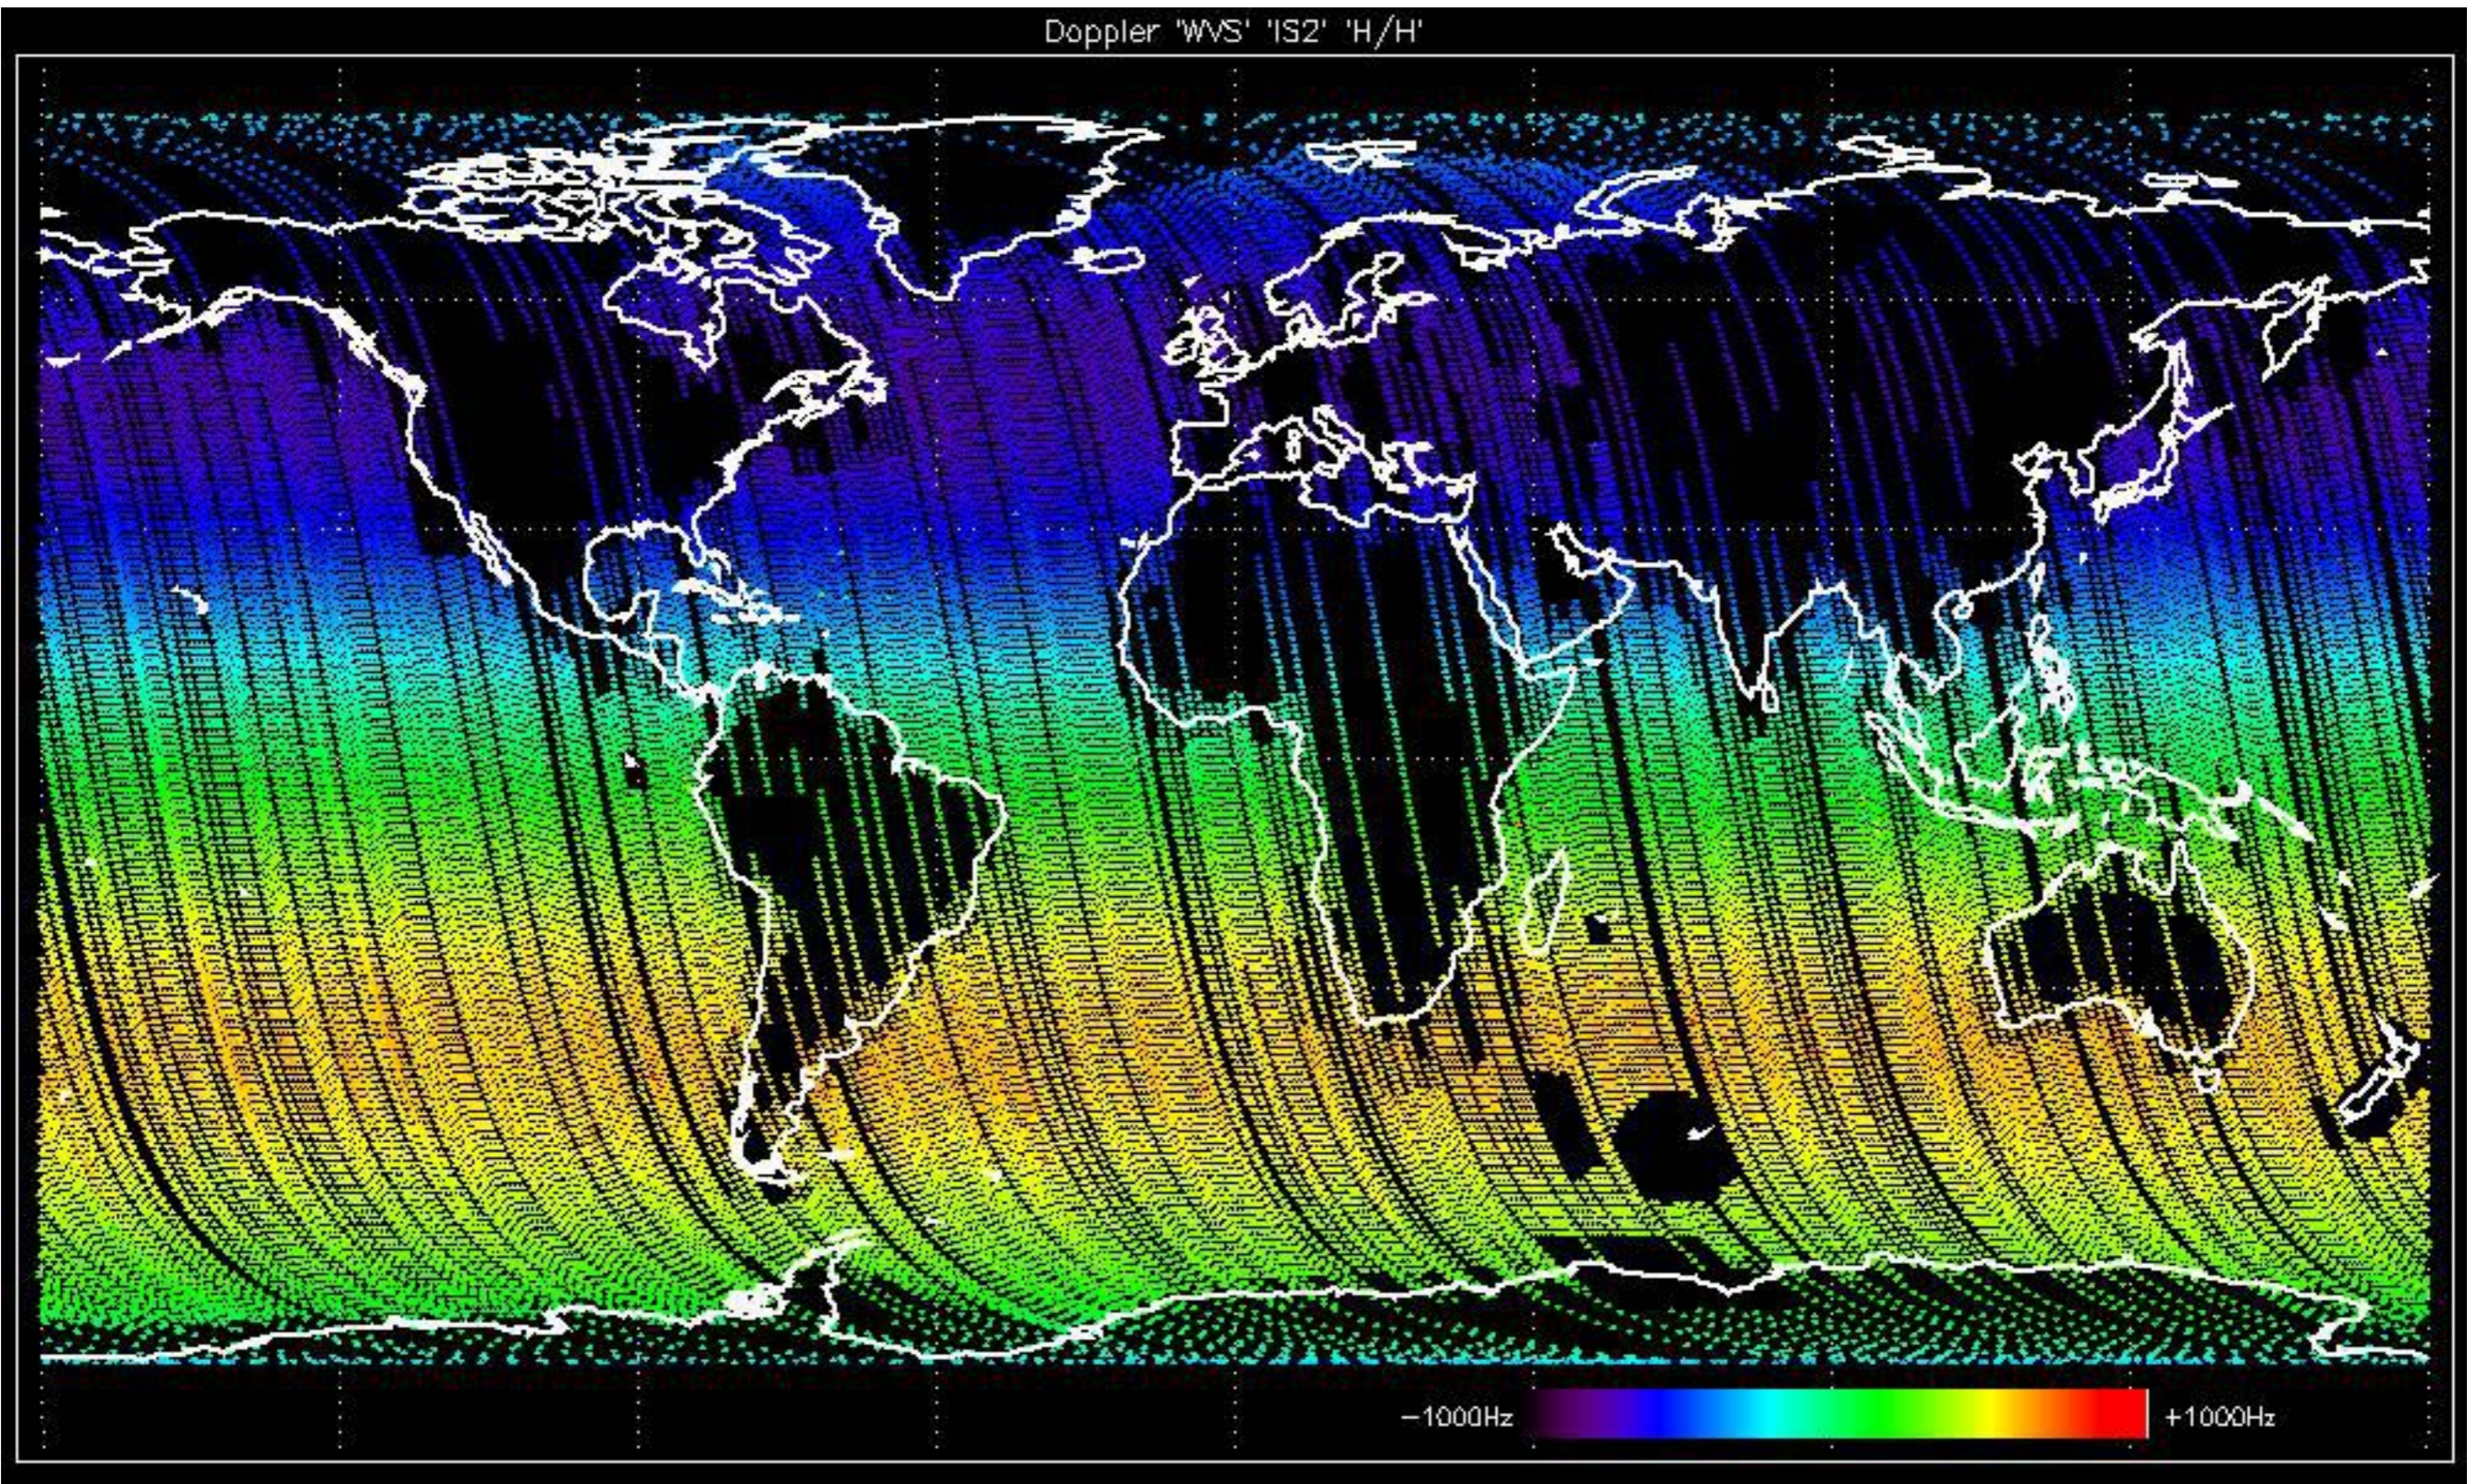




Doppler 'WVS' 'ISZ' 'V/V'

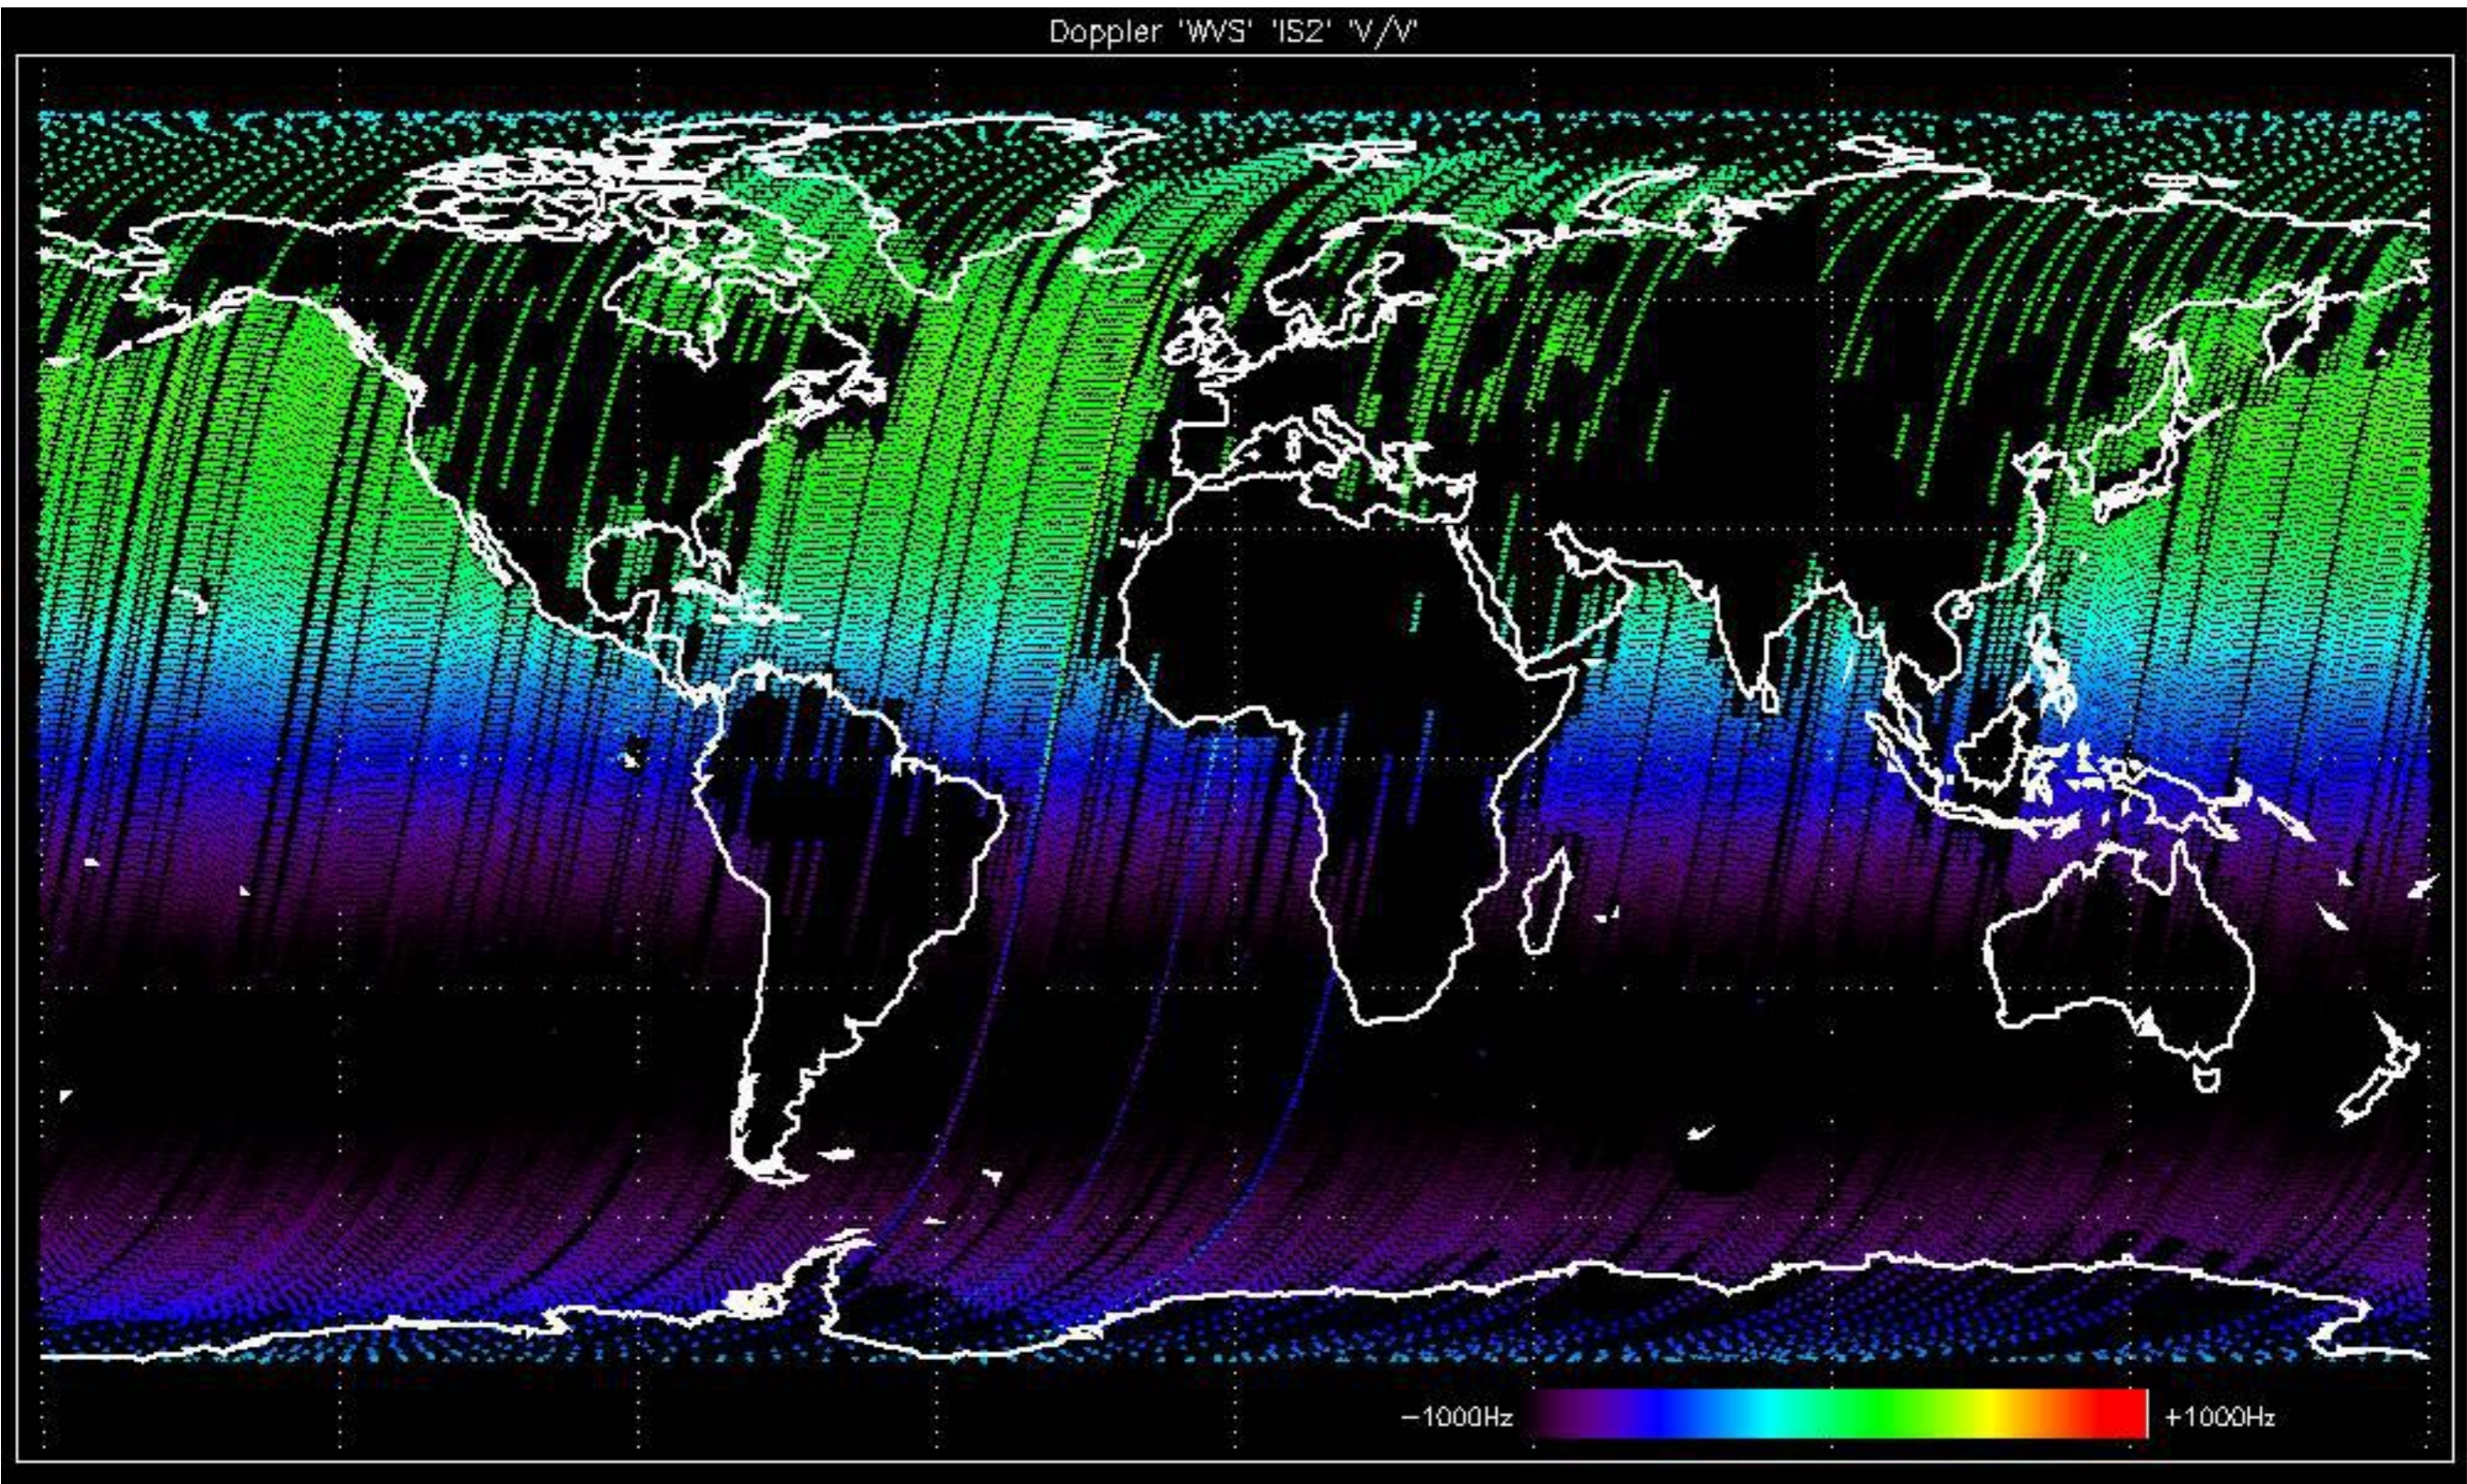




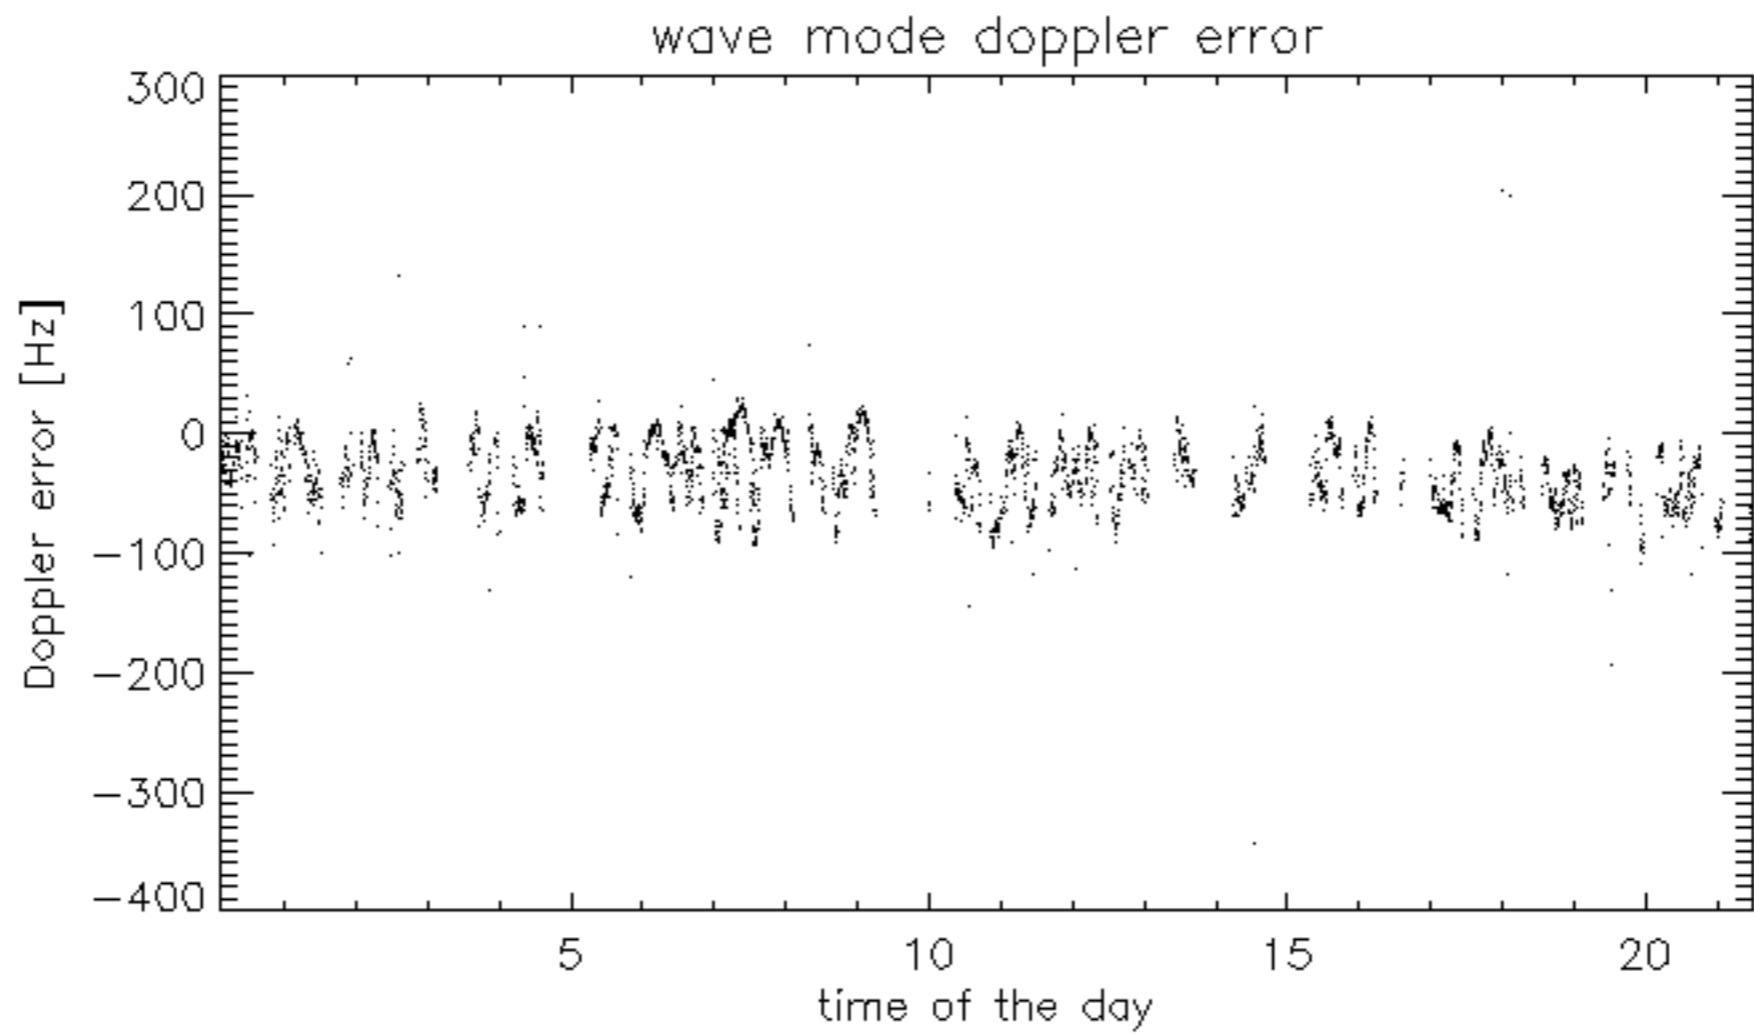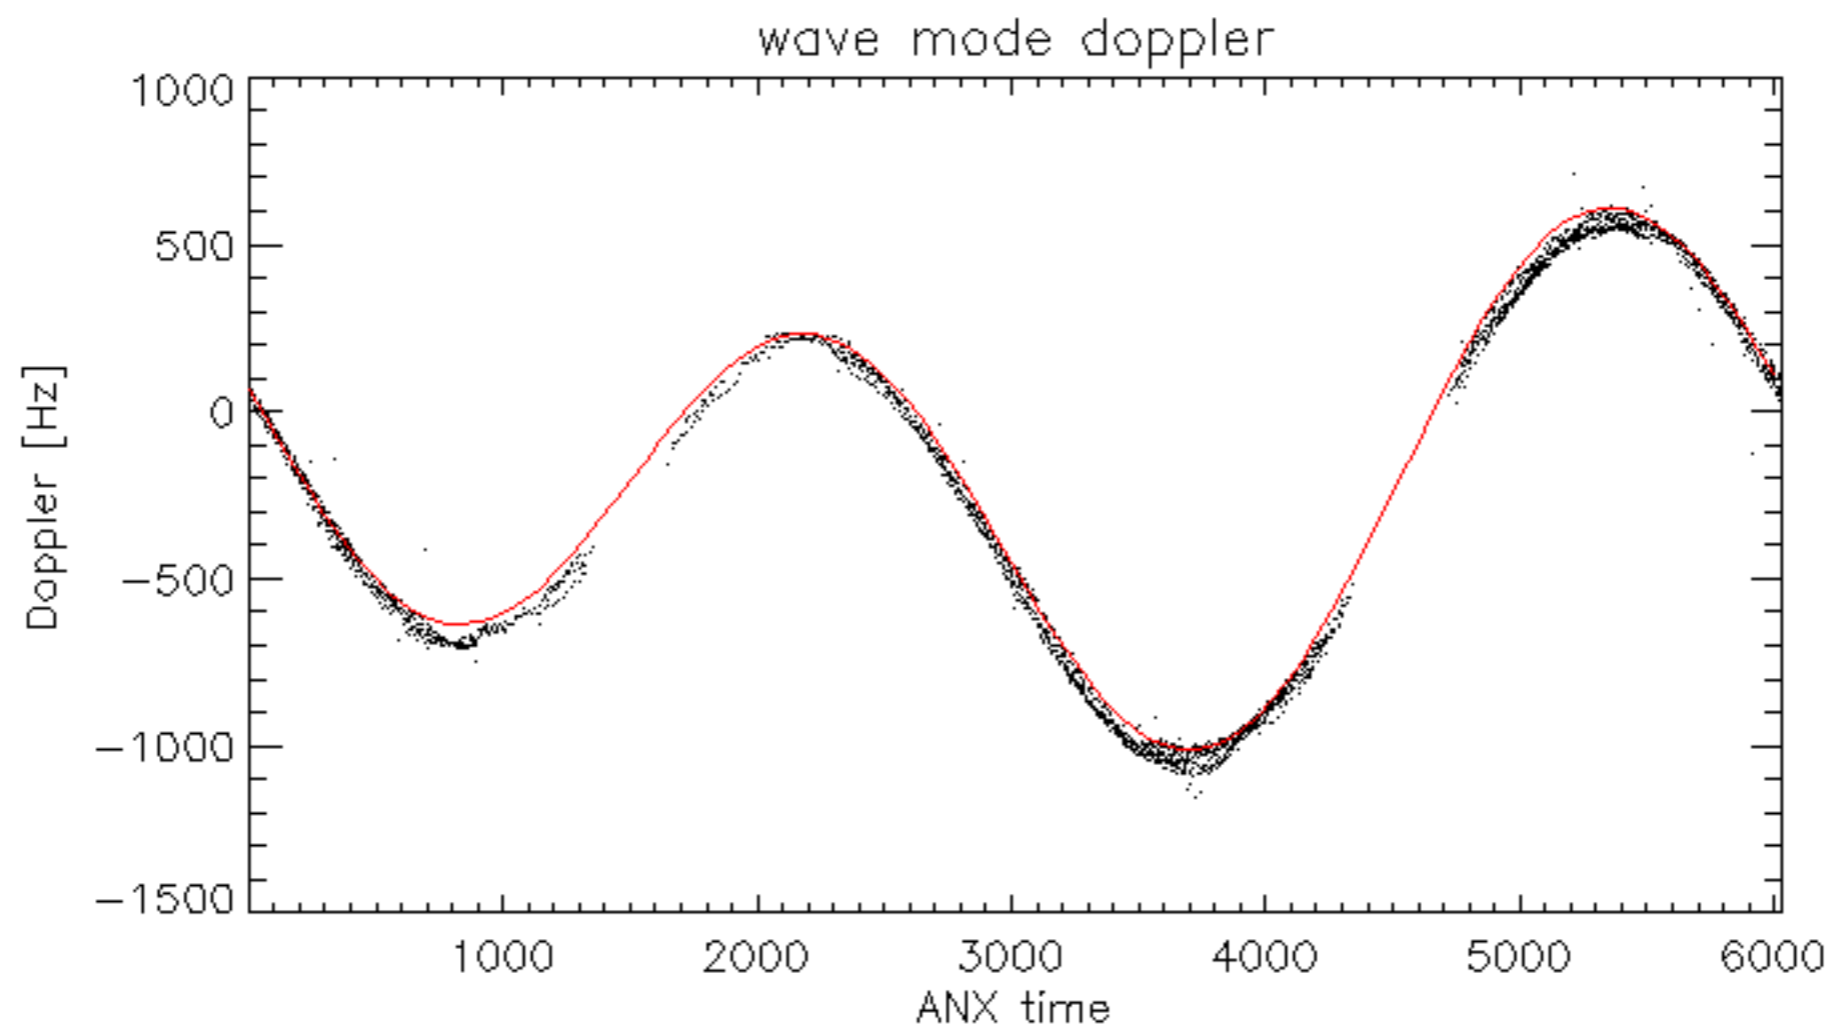




Doppler difference, estimated-predicted 'WVS' 'IS2' 'H/H' -error mean of -30.511724 Hz

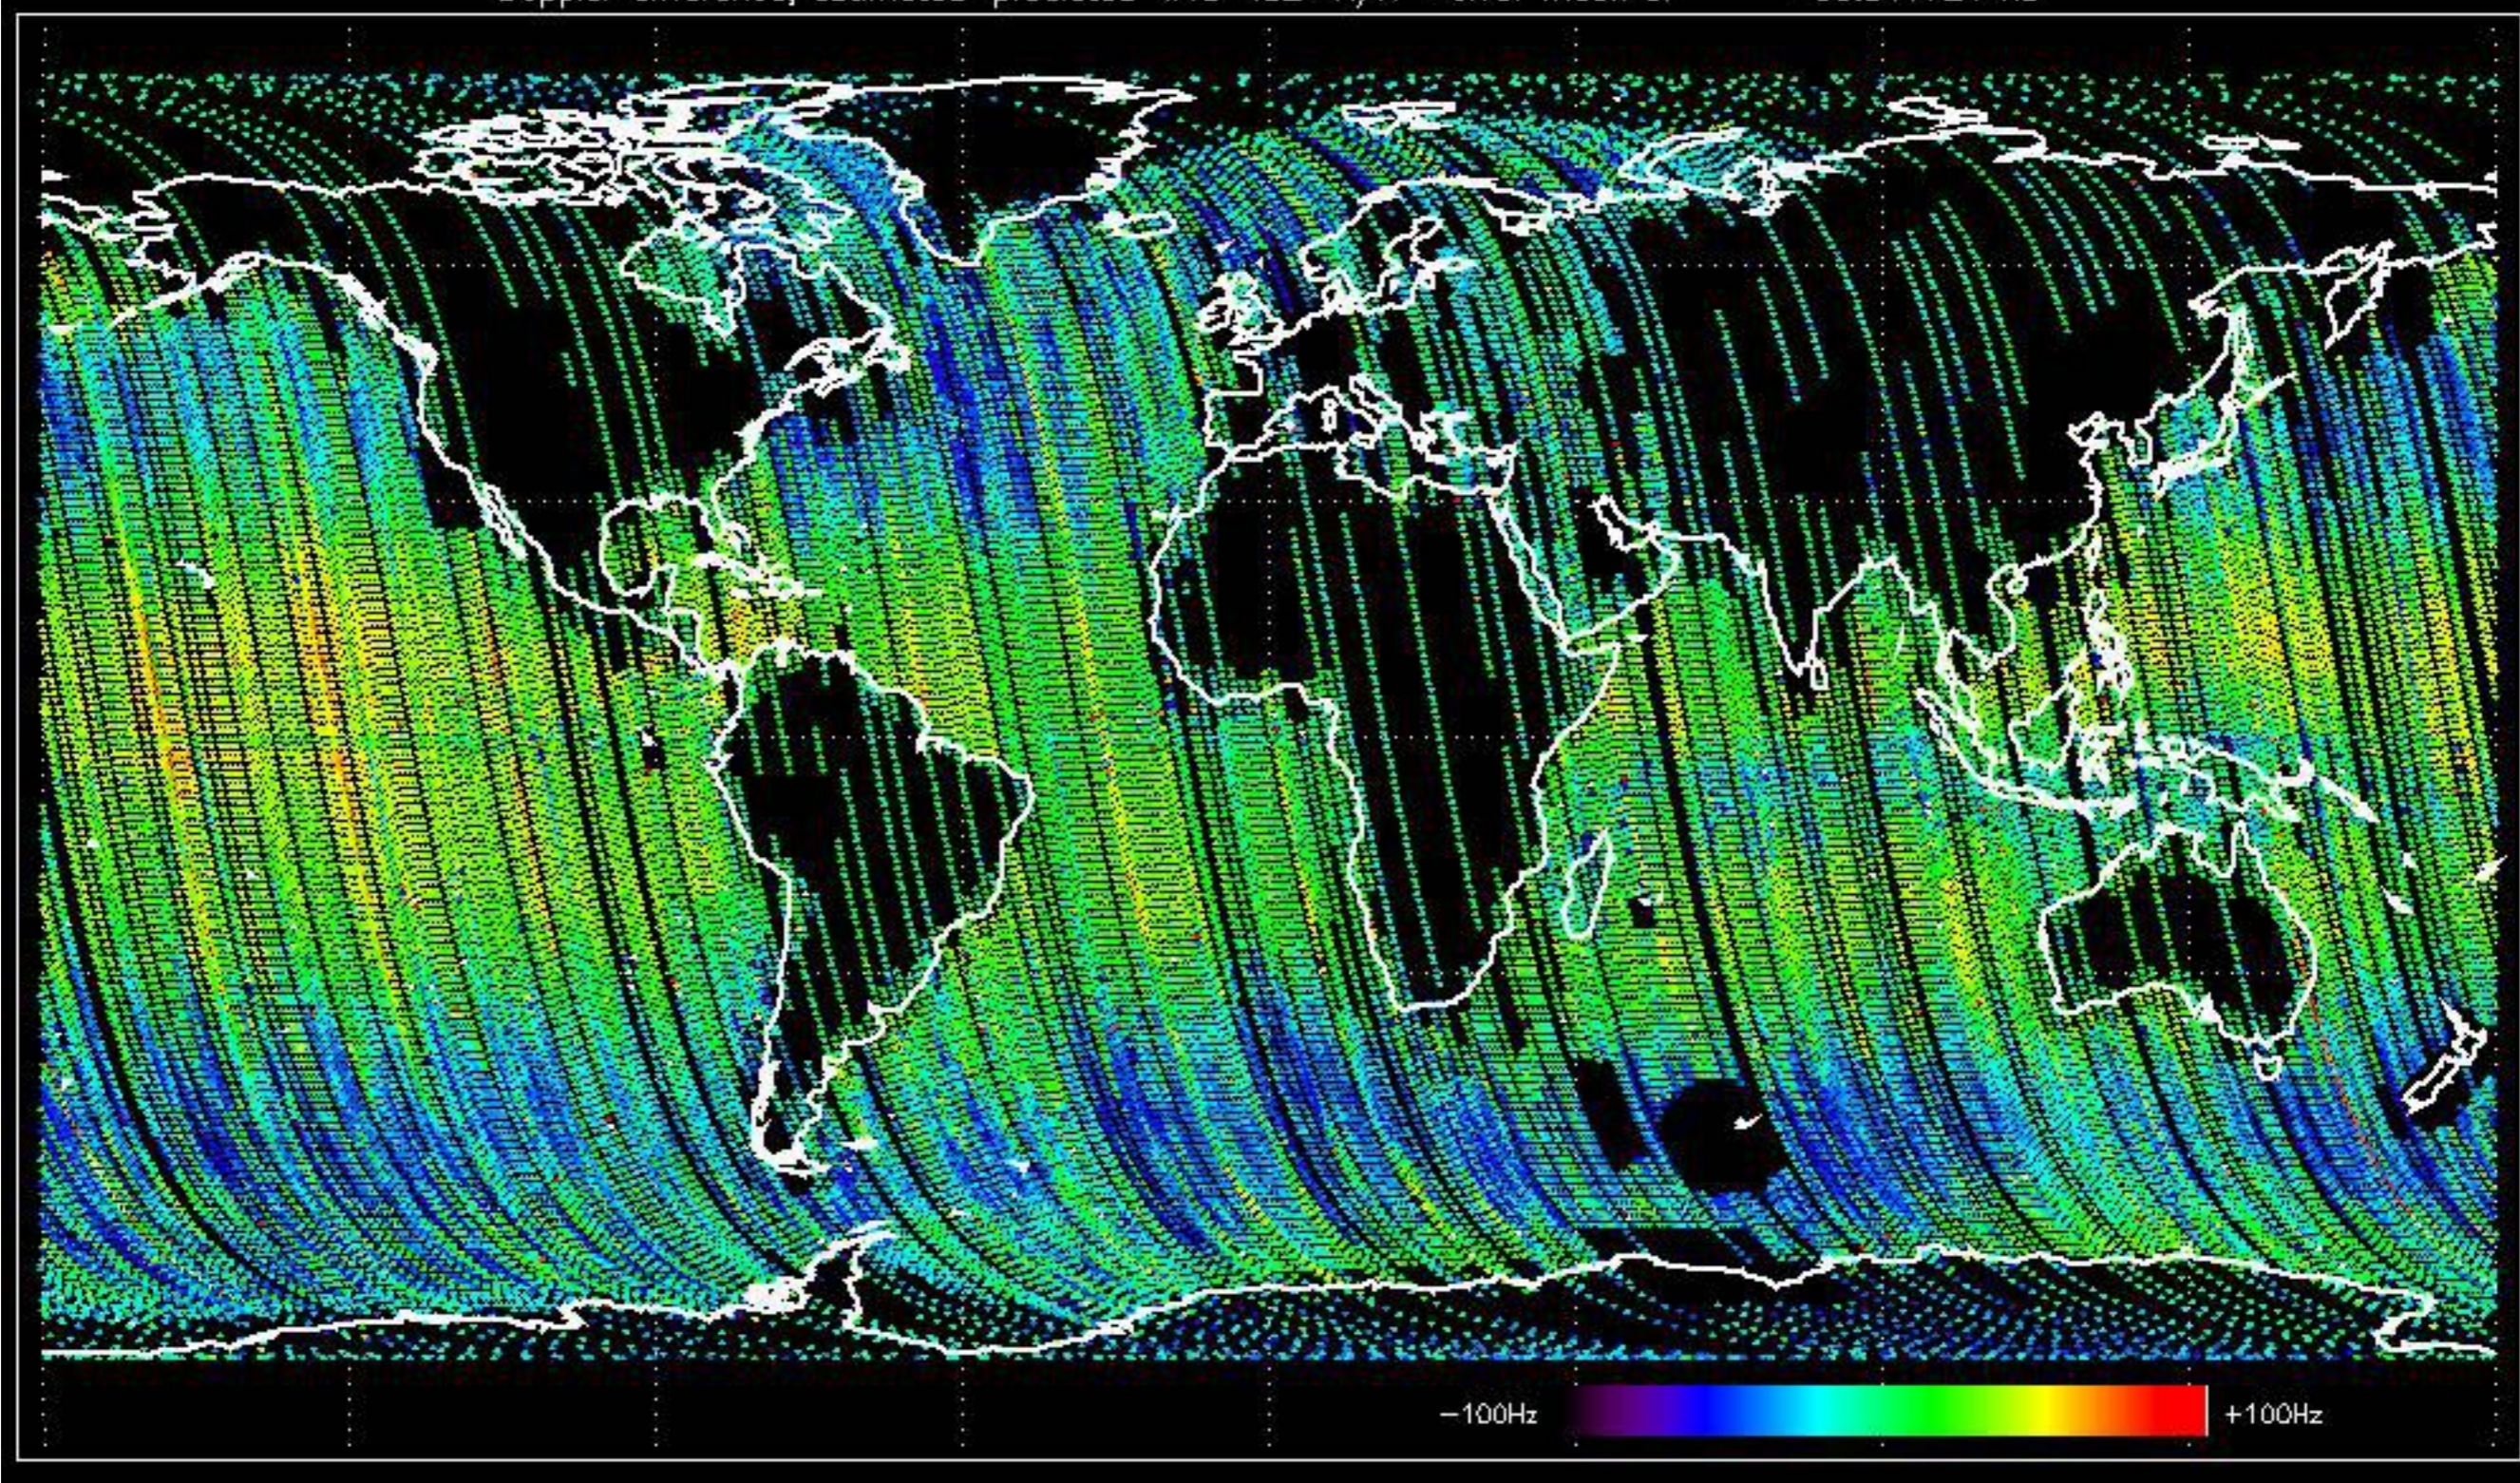



Doppler difference, estimated-predicted 'WVS' 'IS2' 'H/H' -error mean of -30.511724 Hz

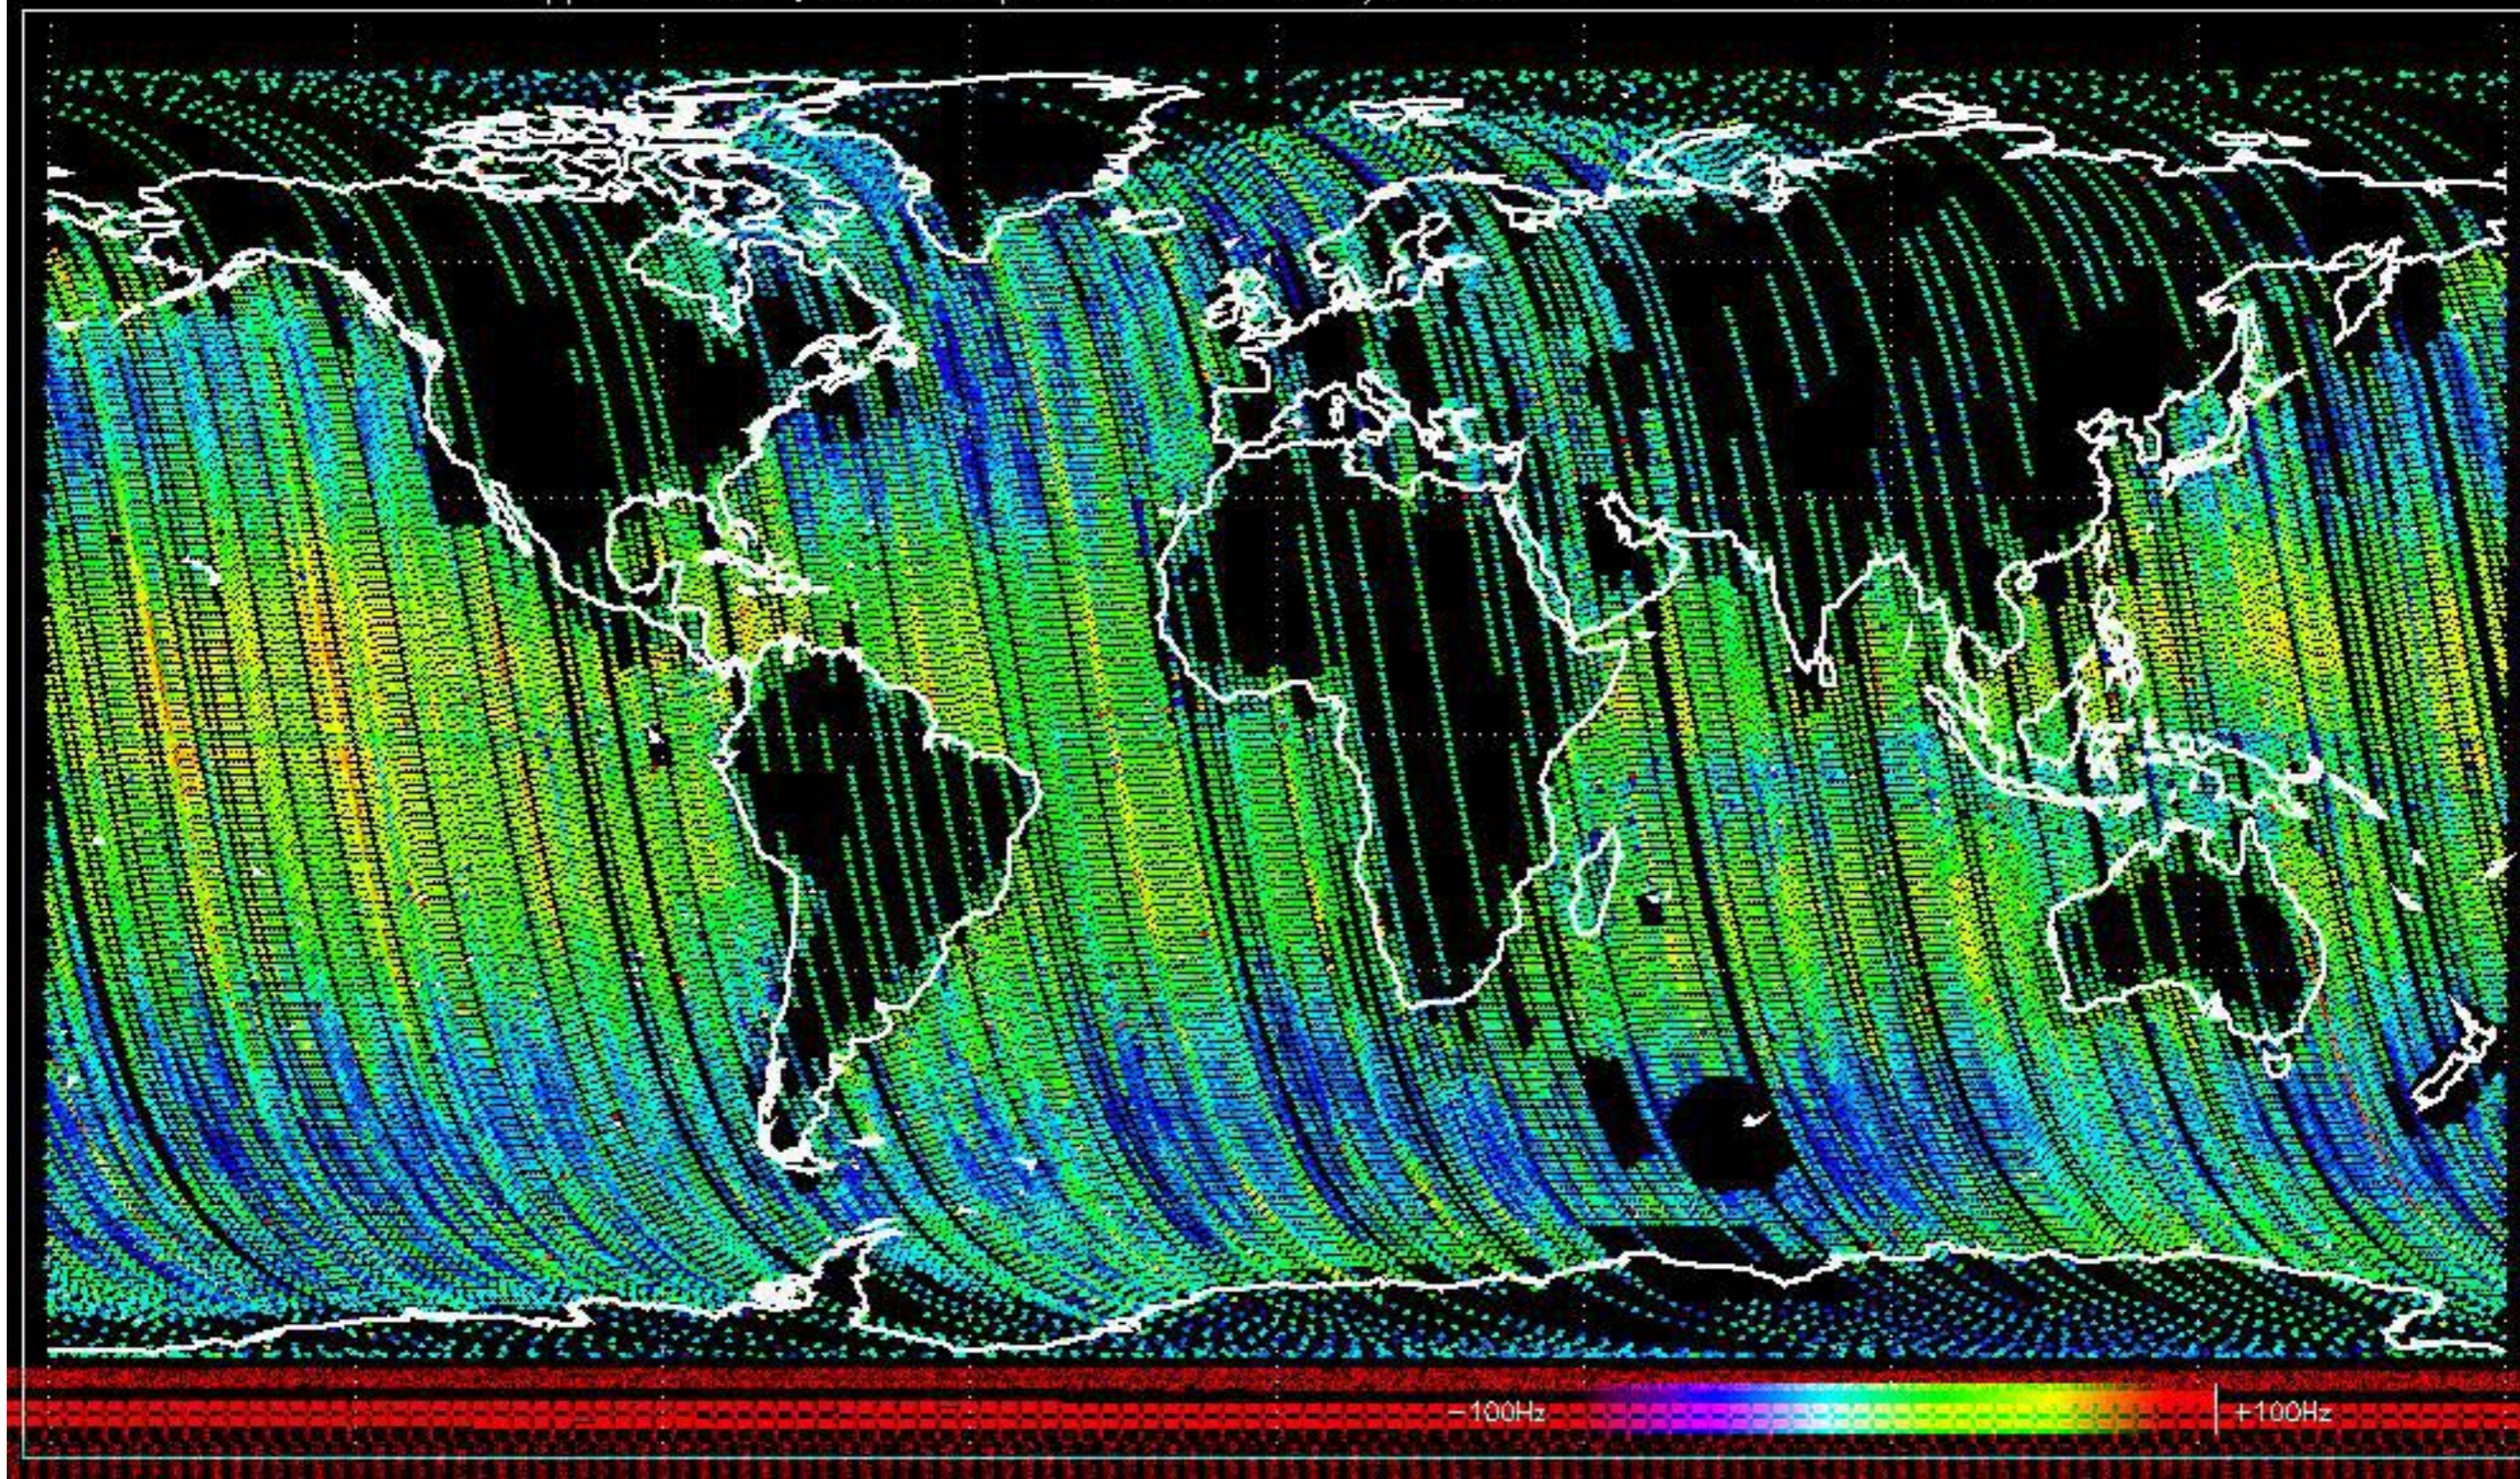



The MS mode provides an internal health check on an individual module basis.  
The purpose of this mode is to identify to identify any malfunctioning modules and  
to identify modules for which calibration offsets are to be applied.  
No anomalies observed on available MS products:

No anomalies observed.


























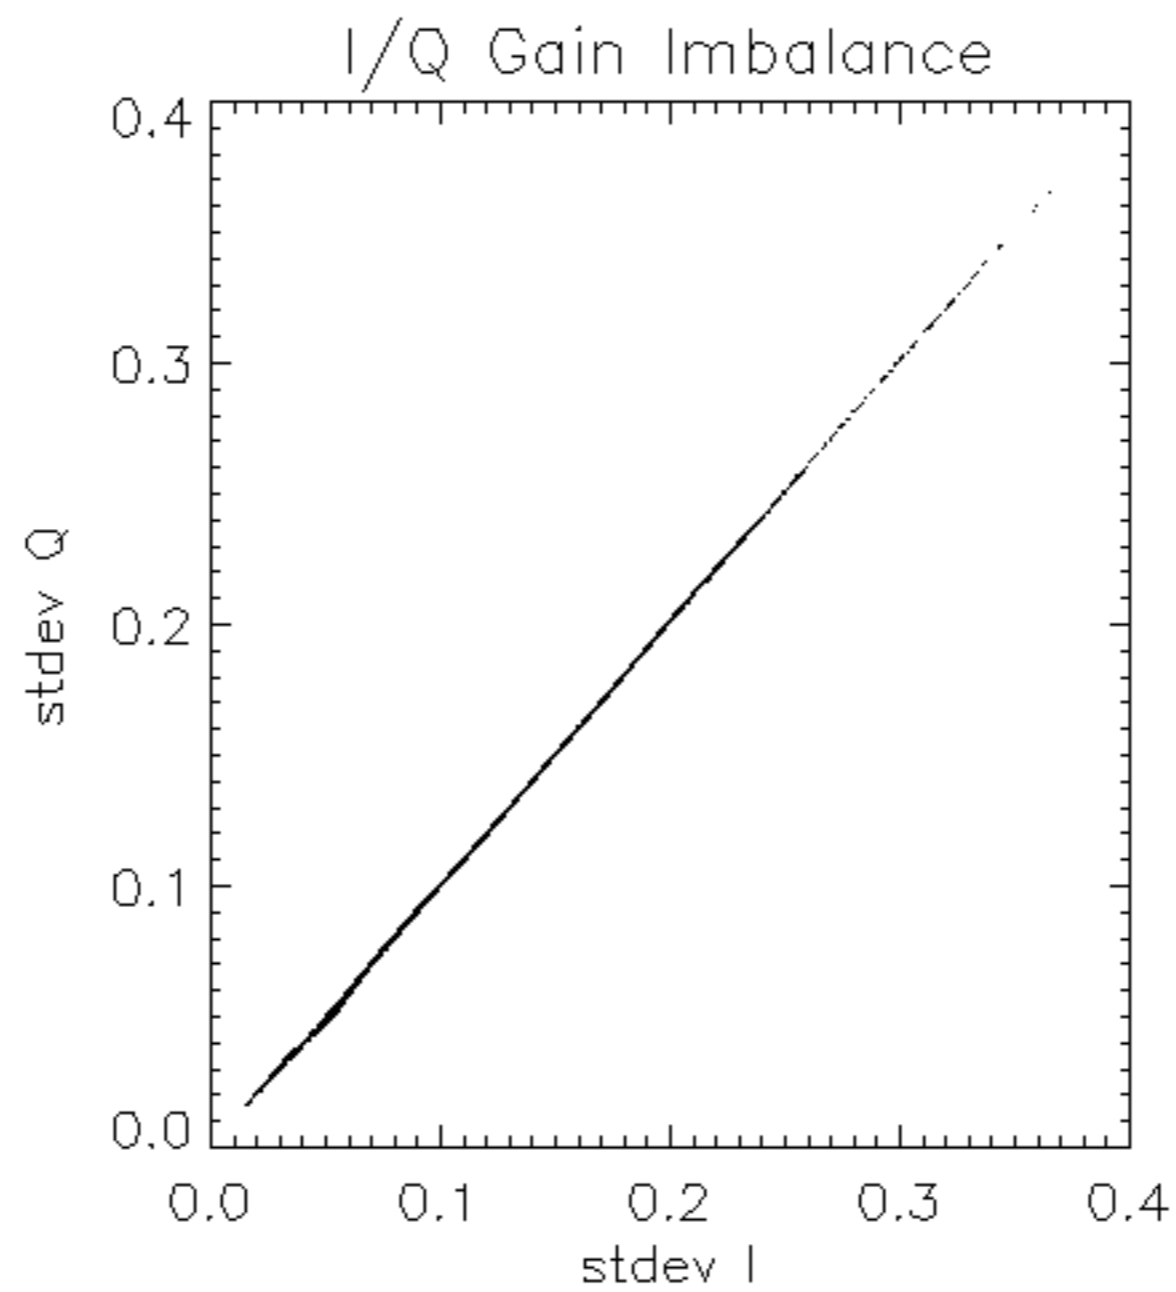

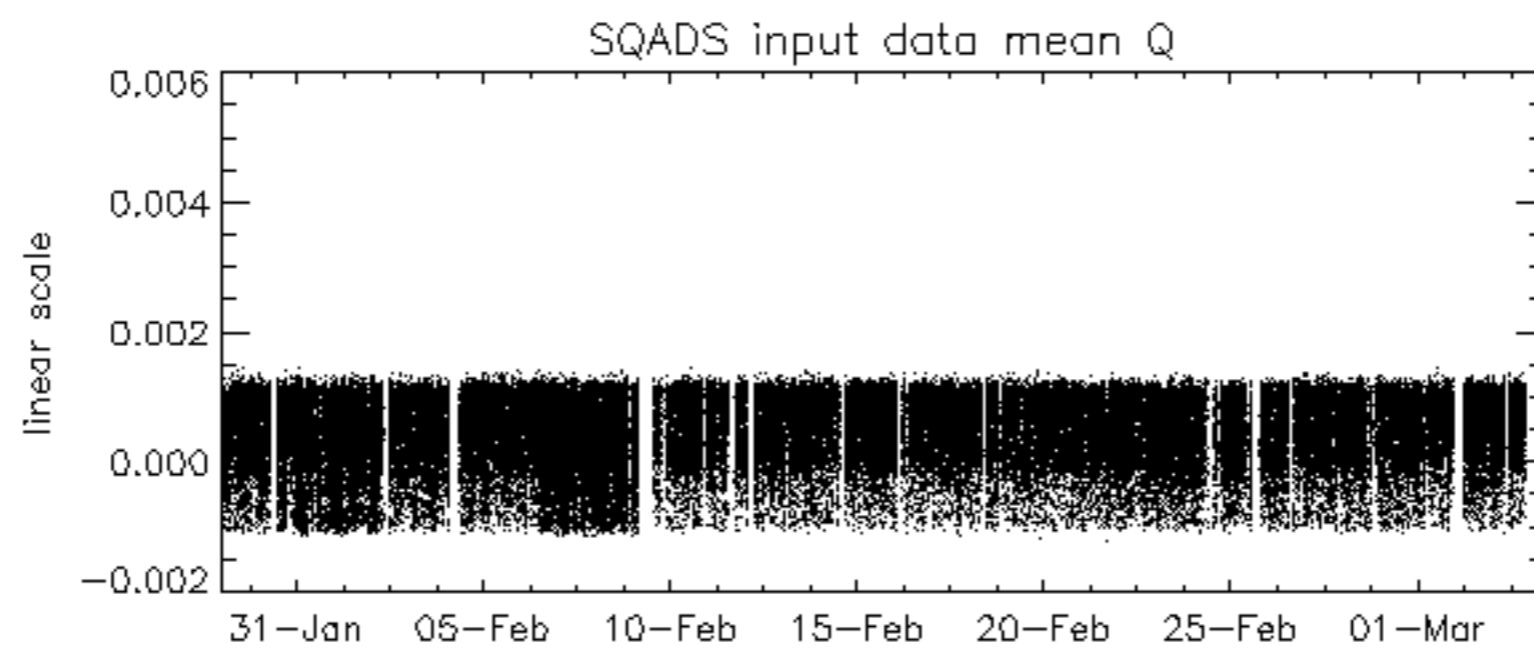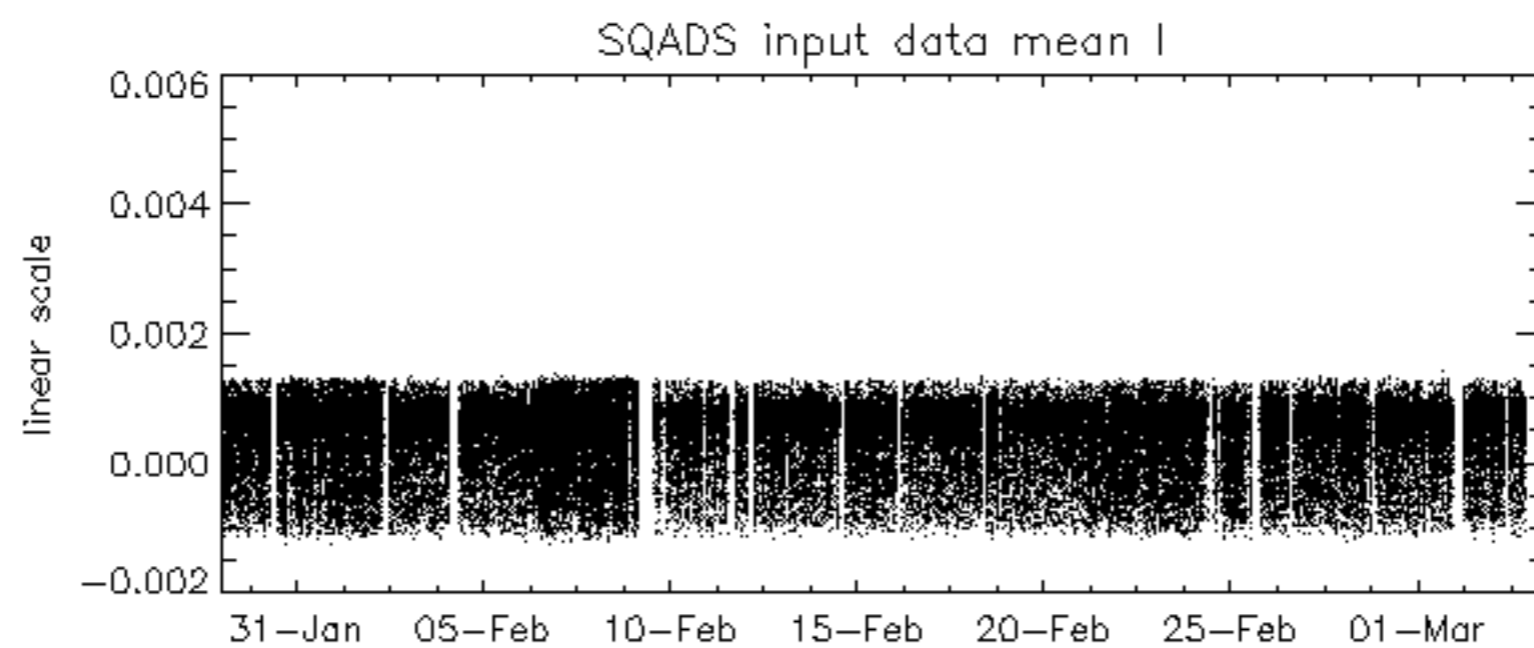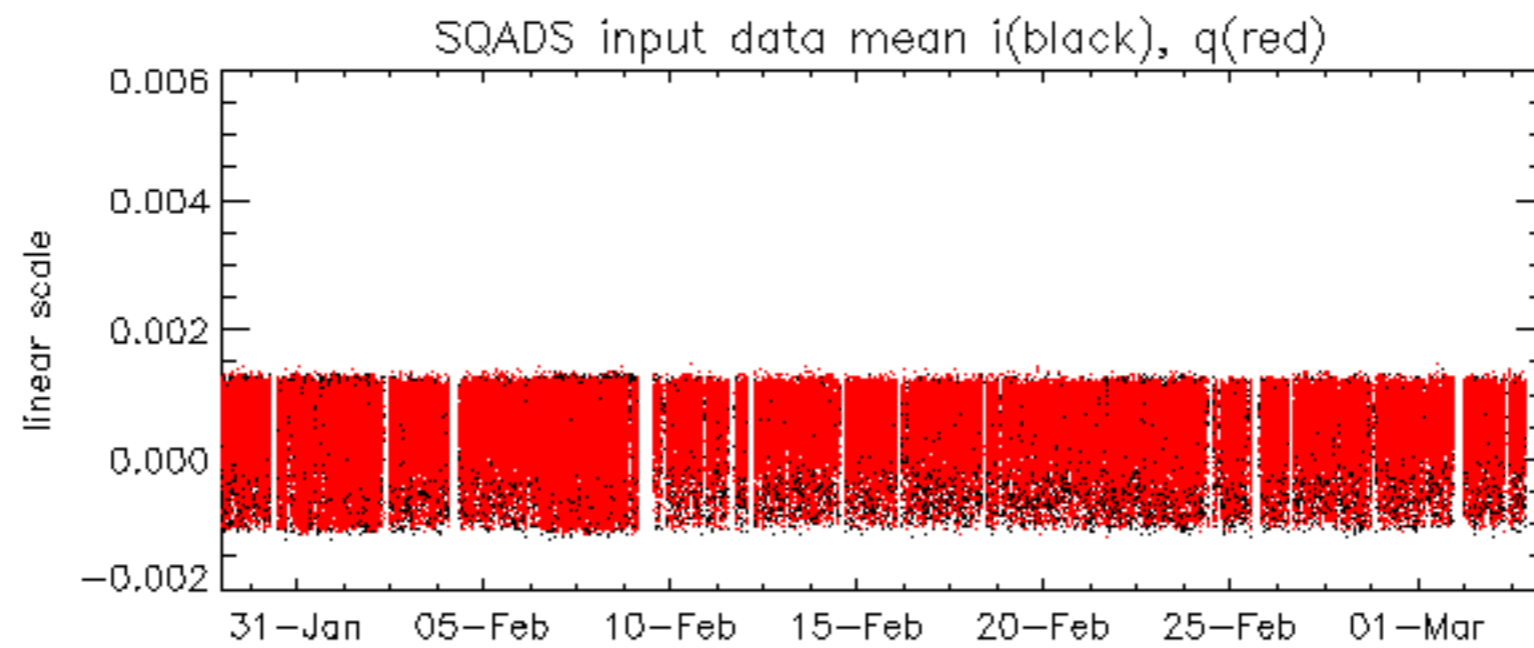

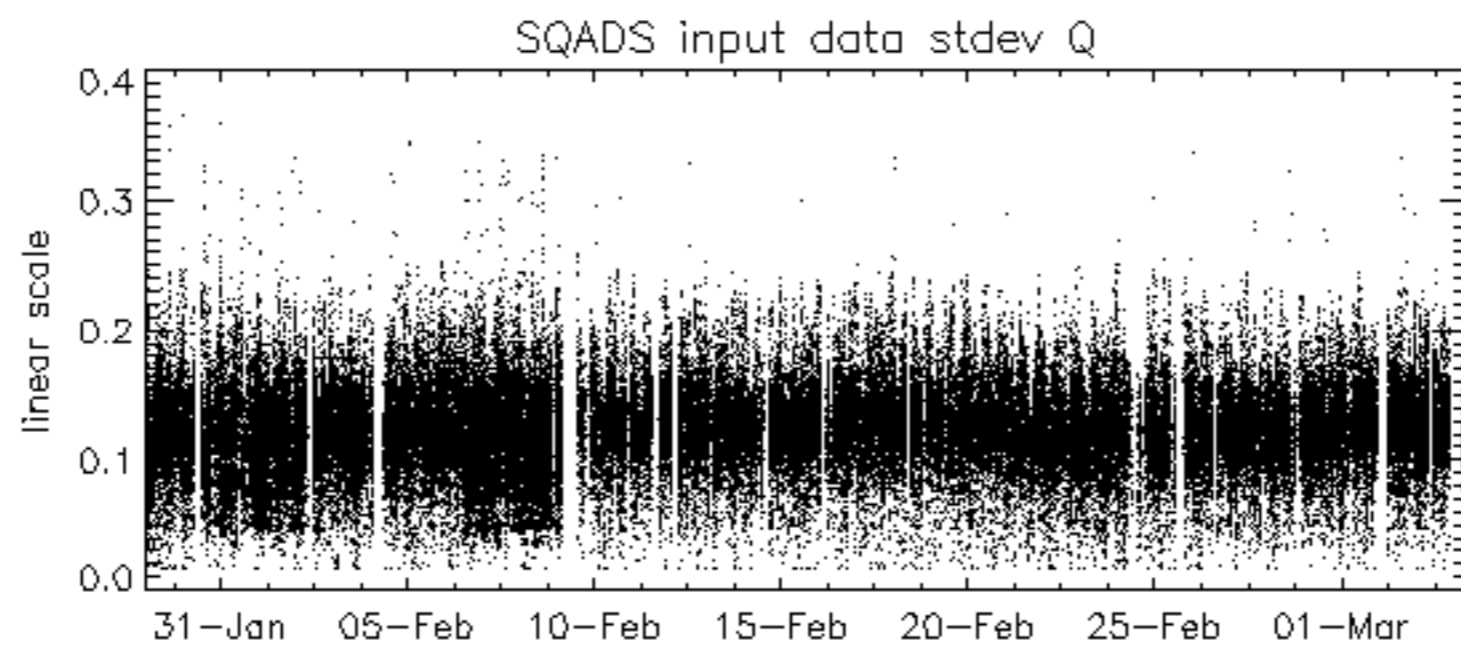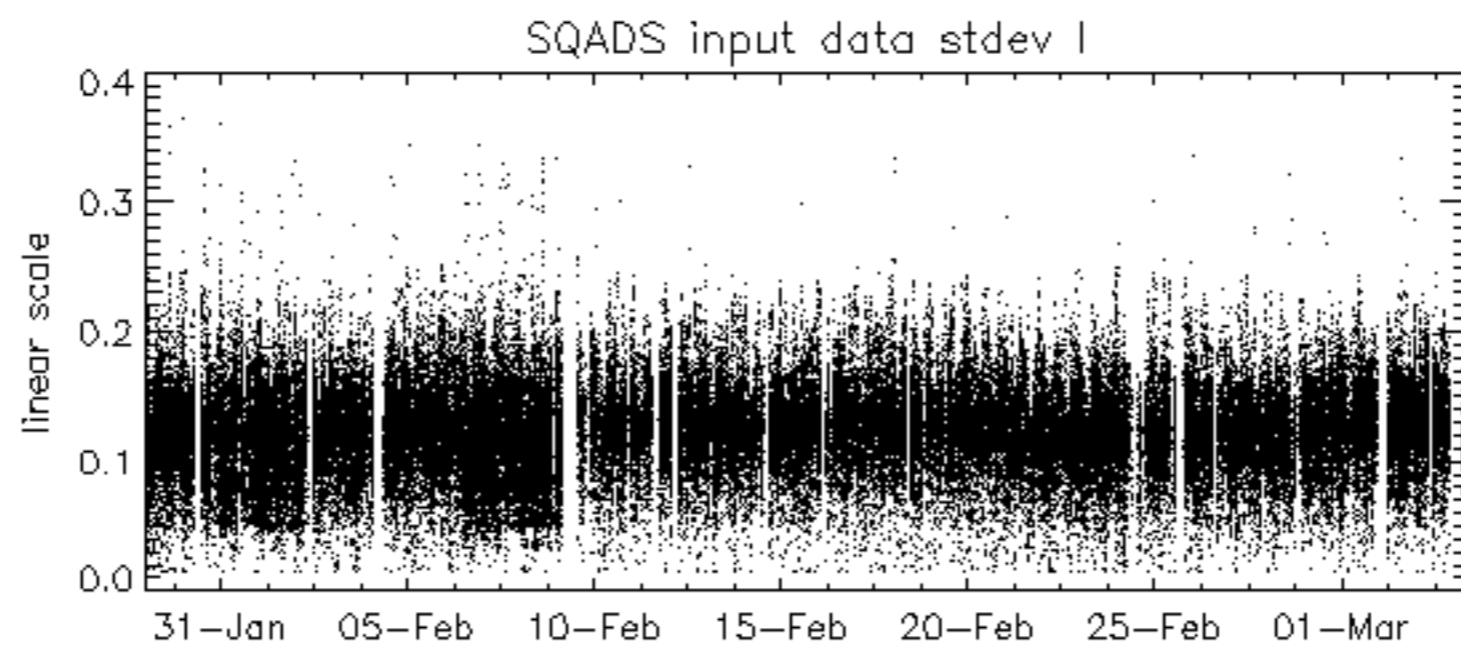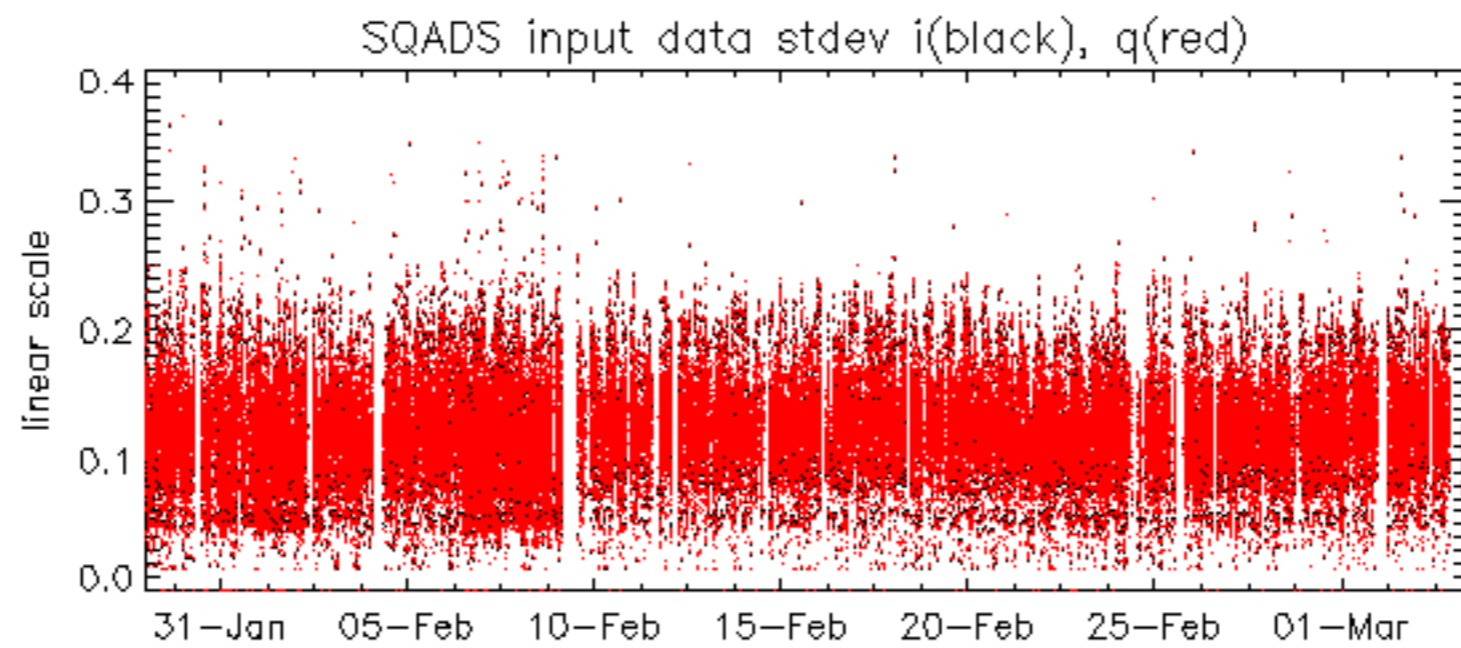



















Antenna reset on 03-MAR-2004 10:00:57 to 10:06:51 due to out of limit temperatures detected on tile D2.