

Analysis from 21-JUN-2007 00:00:00 to 21-JUN-2007 23:59:59. Page generated on 22-JUN-2007 07:45:07.  
View log file: ASAR\_Daily\_Report\_20070622\_0730.log. For any anomalies please contact [msantuari@serco.it](mailto:msantuari@serco.it), [mtranfaglia@serco.it](mailto:mtranfaglia@serco.it).

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

## SUMMARY

1. DATA SUMMARY
  - 1.1 Summary tables
  - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
  - 2.1 IECF operational ADFs list
  - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
  - 3.1 V/V polarisation
  - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
  - 4.1 Analysis for WVS IS2 V/V
    - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
    - 4.1.2 All Rows Analysis for WVS IS2 V/V
  - 4.2 Analysis for GM1 SS3 H/H
    - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
    - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
  - 5.1 Analysis for WVS IS2 V/V
    - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
    - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
  - 5.2 Analysis for GM1 SS1 H/H
    - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
    - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
  - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
  - 6.1 Analysis for WSM SS1
    - 6.1.1 ScaleFactor
7. RAW DATA ANALYSIS
  - 7.1 Analysis for WVS
  - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
  - 8.1 Number of Missing Lines
  - 8.2 Number of Gaps

---

## 1 - DATA SUMMARY

### 1.1 - Summary tables

[ [BACK TO MENU](#) ]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	4	PDE	WS	H/H	28	PDE	IS1	H/H	1	PDE	IS1	H/H	1	PDE	WS	H/H	34	PDK	2007-06-21 07:47:17	V	320
PDE	IS2	V/V	24	PDK	WS	H/H	49	PDE	IS2	H/H	1	PDE	IS2	H/H	2	PDE	WS	V/V	10				
PDK	IS2	V/V	26					PDE	IS4	H/V	1	PDE	IS2	V/V	7	PDK	WS	H/H	8				
								PDE	IS5	H/V	1	PDE	IS4	V/V	1	PDK	WS	V/V	4				
								PDE	IS6	H/H	1	PDE	IS5	H/H	2								
												PDE	IS6	H/H	1								
												PDE	IS6	V/V	2								
												PDE	IS7	V/V	1								
												PDK	IS2	H/H	2								
												PDK	IS2	V/V	1								
												PDK	IS4	V/V	2								

## 1.2 - Lists of products used

[ [BACK TO MENU](#) ]

[[TXT](#)] [[XLS](#)] [List\\_WVS\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_GM1\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_APM\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_IMM\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_WSM\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_MS\\_products\\_used](#)

## 2 - AUXILIARY FILES ANALYSIS

### 2.1 - IECF operational ADFs list

[ [BACK TO MENU](#) ]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20070410_140202_20070204_165113_20071231_000000
ASA_INS_AXVIEC20070306_164819_20070307_060000_20071231_000000
ASA_XCH_AXVIEC20051219_162547_20020301_000000_20081231_000000
ASA_XCA_AXVIEC20070517_153558_20070204_165113_20071231_000000

### 2.2 - Products with wrong ADFs





[ [BACK TO MENU](#) ]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0

[[TXT](#)] [[XLS](#)] [Check\\_ADFs\\_WVS](#)  
 [[TXT](#)] [[XLS](#)] [Check\\_ADFs\\_GM1](#)

### 3 - MODULE STEPPING PRODUCTS ANALYSIS






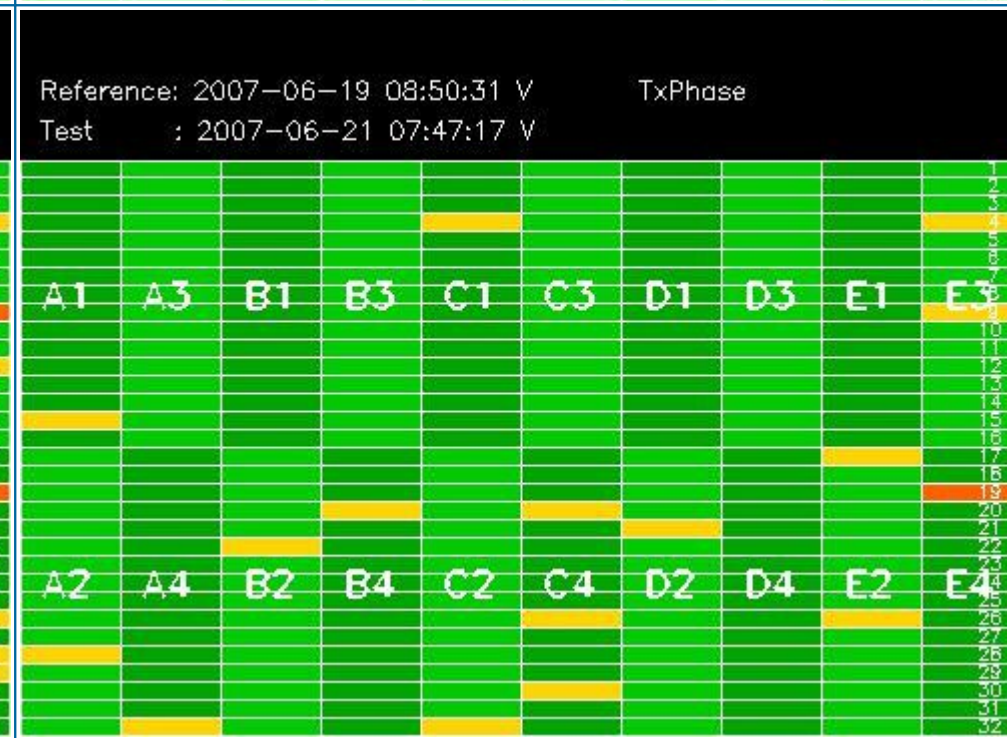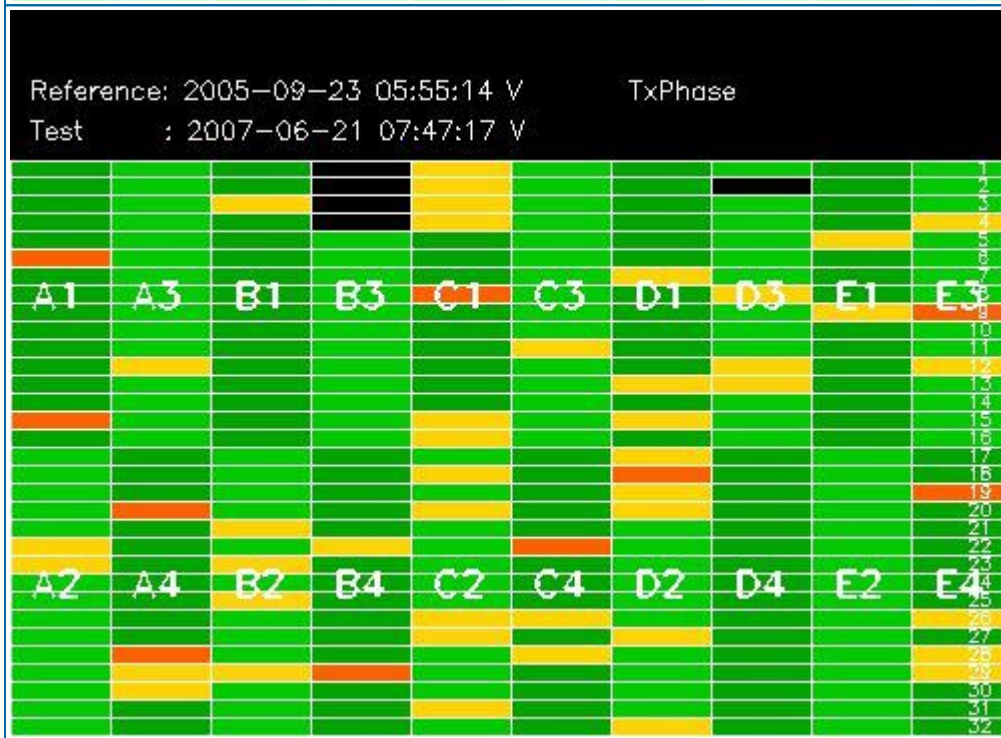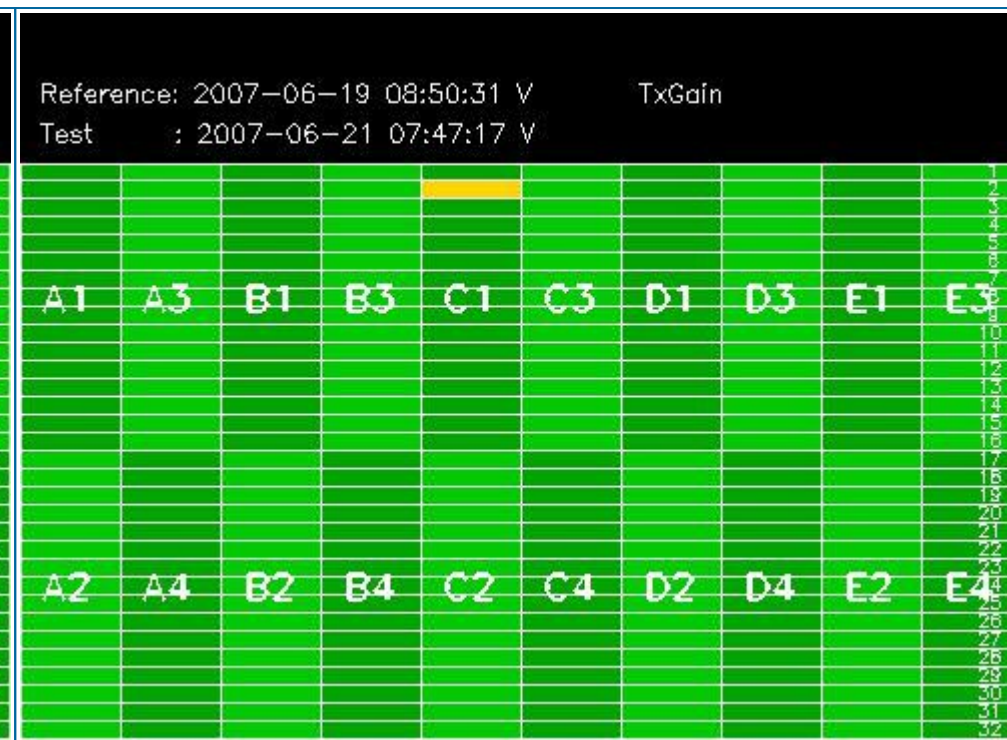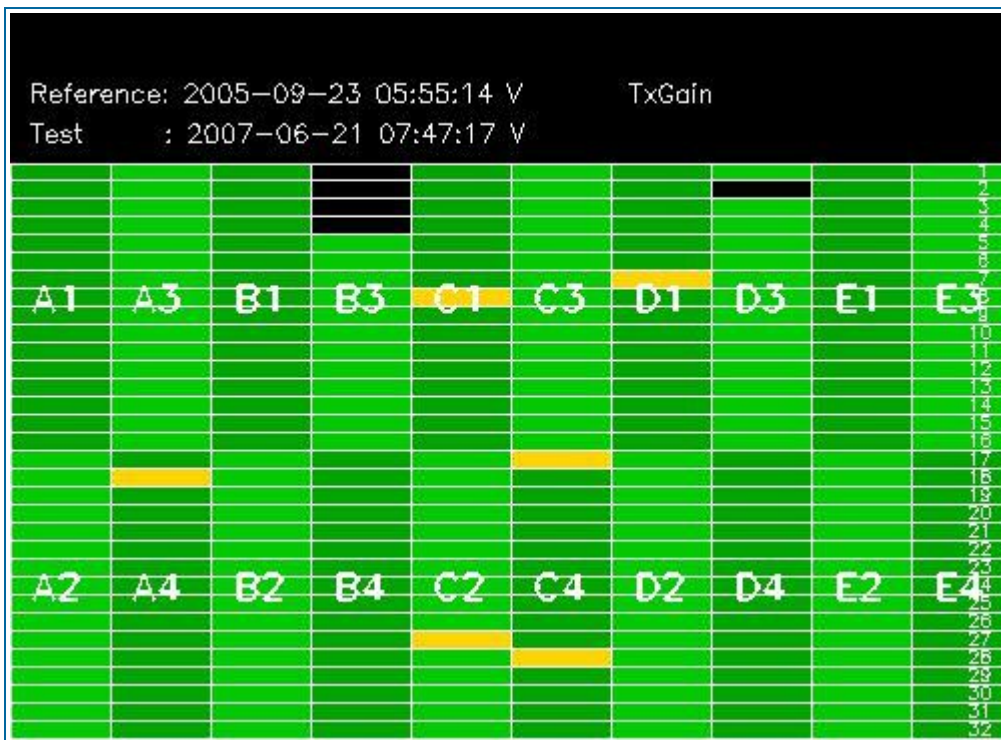

### 3.2 - H/H polarisation

[ [BACK TO MENU](#) ]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
After antenna maintenance (2005-09-22/23)	Previous product in the same polarisation

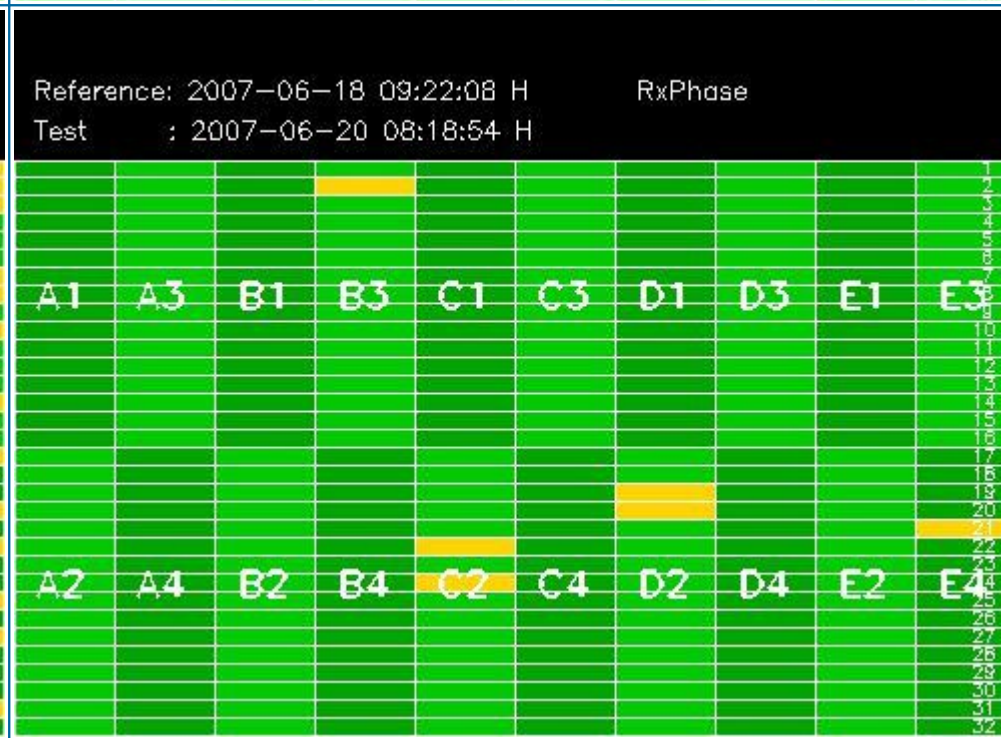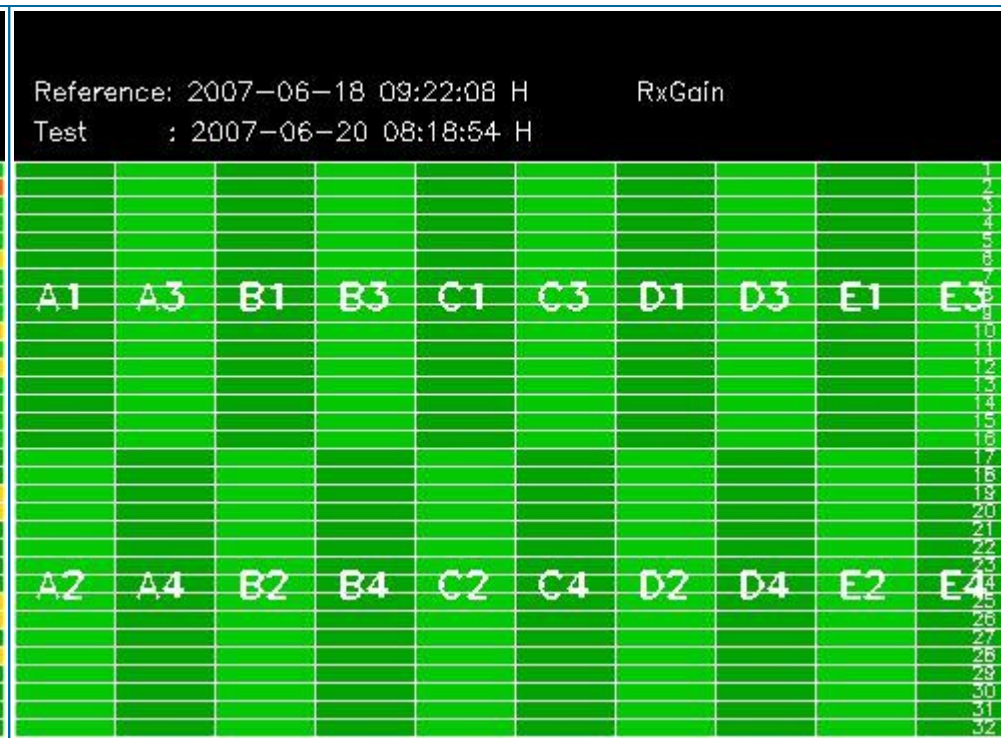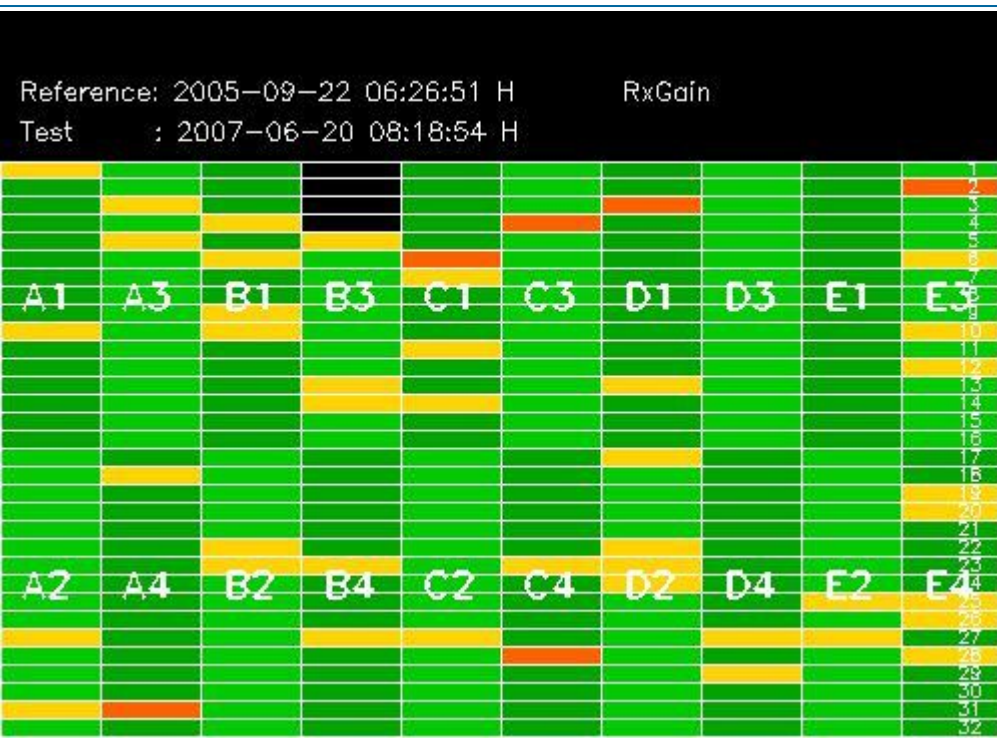



## 4 - CALIBRATION PULSES ANALYSIS

### 4.1 - Analysis for WVS IS2 V/V

#### 4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[ BACK TO MENU ]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

#### 4.1.2 - All Rows Analysis for WVS IS2 V/V

[ BACK TO MENU ]

## 4.2 - Analysis for GM1 SS3 H/H

### 4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H

[ BACK TO MENU ]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

### 4.2.2 - All Rows Analysis for GM1 SS3 H/H


[ BACK TO MENU ]


## 5 - DOPPLER ANALYSIS

### 5.1 - Analysis for WVS IS2 V/V

#### 5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[ BACK TO MENU ]

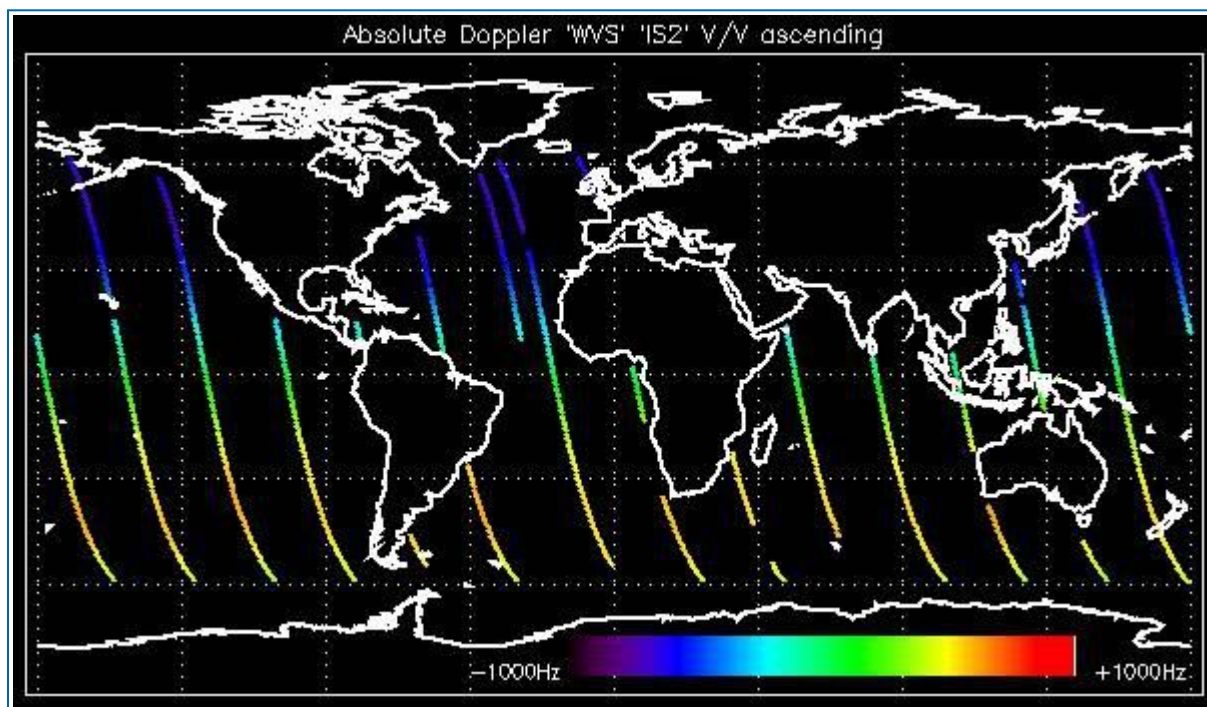

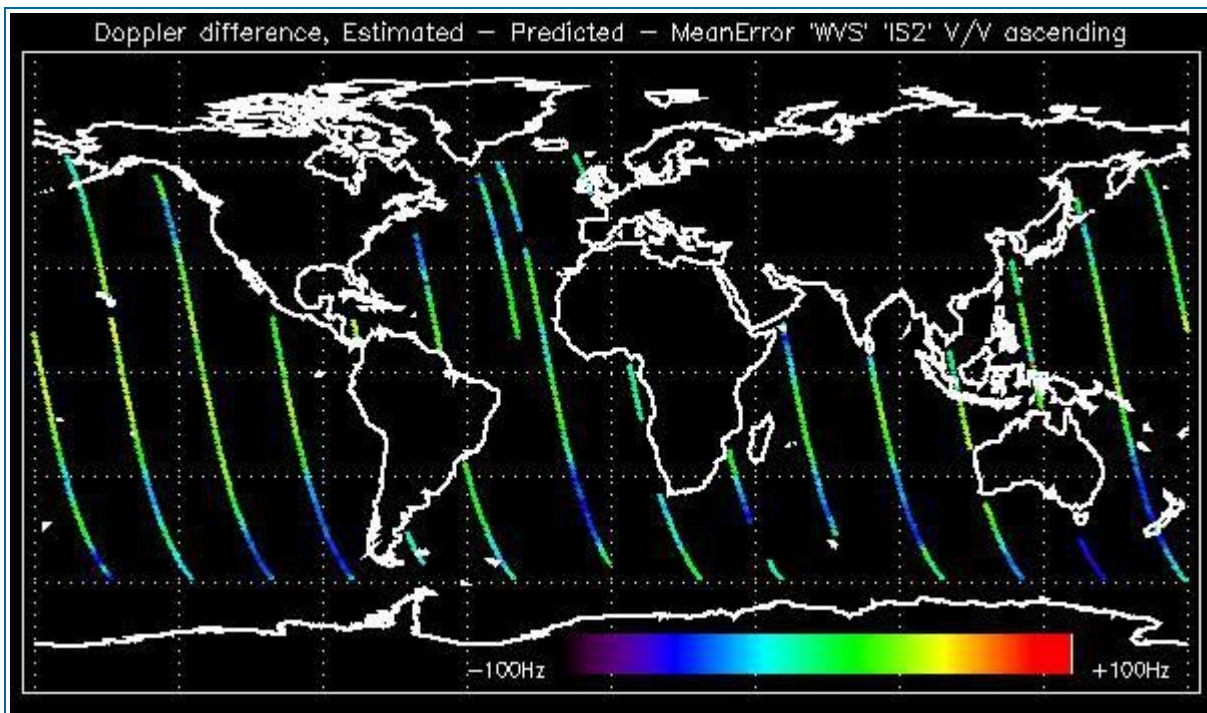

### 5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[ BACK TO MENU ]

## 5.2 - Analysis for GM1 SS1 H/H

### 5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[ BACK TO MENU ]

### 5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[ BACK TO MENU ]

## 5.3 - Doppler JUMPS Analysis for WSM

[ BACK TO MENU ]

## 6 - CHIRP ANALYSIS



### 6.1 - Analysis for WSM SS1

#### 6.1.1 - ScaleFactor

[ BACK TO MENU ]

--	--





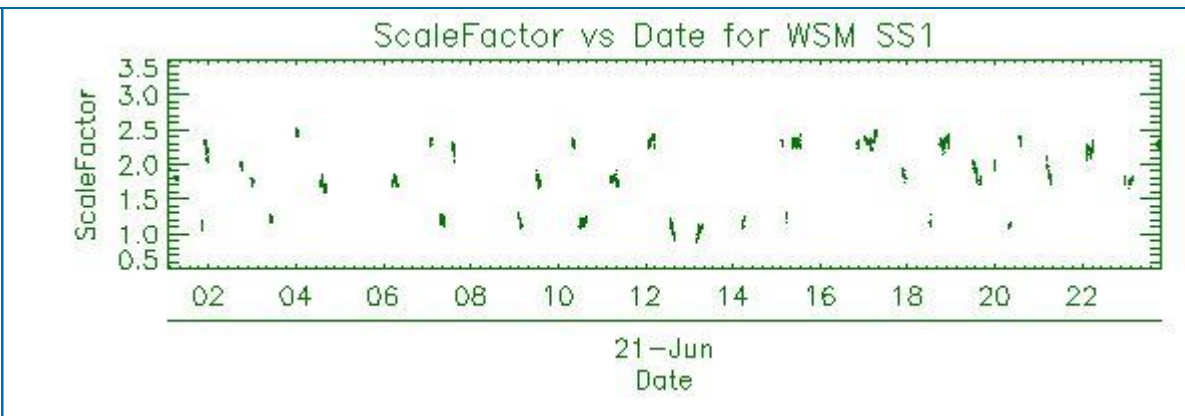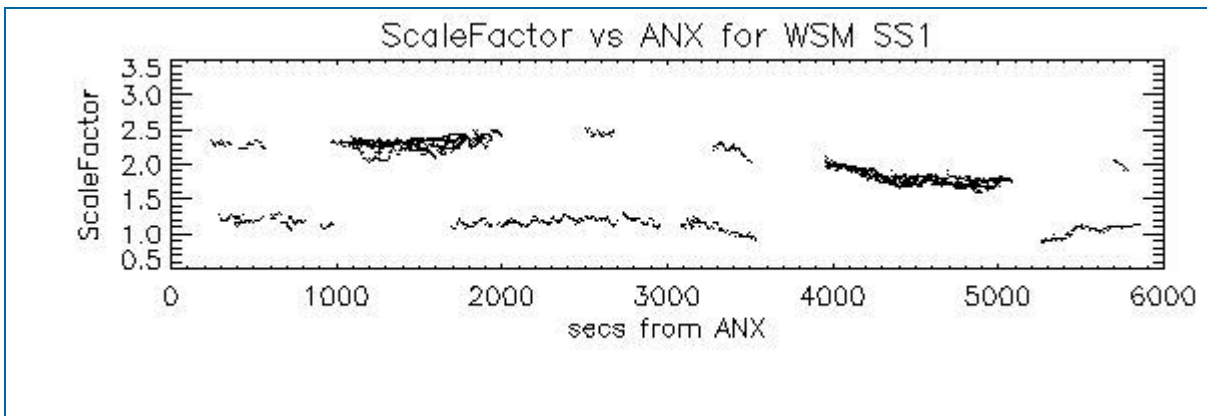

## 7 - RAW DATA ANALYSIS

### 7.1 - Analysis for WVS

[ [BACK TO MENU](#) ]

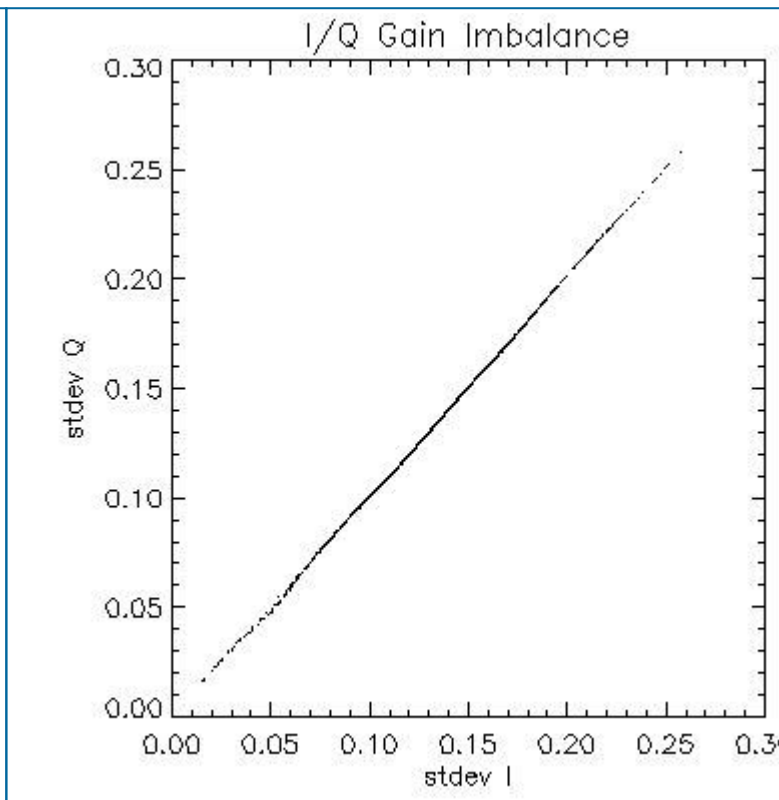

Channel	Statistics	DSS-B
MEAN I	mean	0.000560761
	stdev	1.75554e-07
MEAN Q	mean	0.000515857
	stdev	2.29858e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.136151
	stdev	0.00125138
STDEV Q	mean	0.136512
	stdev	0.00126812

### 7.2 - Analysis for IMM

[ [BACK TO MENU](#) ]

Channel	Statistics	DSS-B
MEAN I	mean	0.000312095
	stdev	4.69455e-09
MEAN Q	mean	0.000525592
	stdev	5.23839e-09
Channel	Statistics	DSS-B
STDEV I	mean	0.0664021
	stdev	0.000739871
STDEV Q	mean	0.0666531
	stdev	0.000747025

## 8 - TELEMETRY ANALYSIS

Processing Center	Product	Gaps	Missing lines
PDE	ASA_WSM_1PNPDE20070621_032329_000002752059_00133_27742_7262.N1	0	66

### 8.1 - Number of Missing lines

[ BACK TO MENU ]

### 8.2 - Number of Gaps

[ BACK TO MENU ]

#####  
ASAR DAILY REPORT for 070621  
#####

MODE: DAILY  
ANALYSIS: ALL  
DATE: YESTERDAY

Analysis will be performed from 2007-06-21 00:00:00 to 2007-06-21 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/070621/

DATA SUMMARY

#####  
Summary will be performed from 2007-06-21 00:00:00 to 2007-06-21 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/070621/DATA\_SUMMARY

Creating directory ./RESULTS/DAILY/070621/DATA\_SUMMARY...  
Writing file ./RESULTS/DAILY/070621/DATA\_SUMMARY/Data\_summary.html...

\*\*\*\*\*  
Getting WVS products list from 2007-06-21 00:00:00 to 2007-06-21 23:59:59...  
Writing file ./RESULTS/DAILY/070621/DATA\_SUMMARY/List\_WVS\_products\_used.xls...  
Writing file ./RESULTS/DAILY/070621/DATA\_SUMMARY/List\_WVS\_products\_used.txt...

\*\*\*\*\*  
Getting GM1 products list from 2007-06-21 00:00:00 to 2007-06-21 23:59:59...  
Writing file ./RESULTS/DAILY/070621/DATA\_SUMMARY/List\_GM1\_products\_used.xls...  
Writing file ./RESULTS/DAILY/070621/DATA\_SUMMARY/List\_GM1\_products\_used.txt...

\*\*\*\*\*  
Getting APM products list from 2007-06-21 00:00:00 to 2007-06-21 23:59:59...  
Writing file ./RESULTS/DAILY/070621/DATA\_SUMMARY/List\_APM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/070621/DATA\_SUMMARY/List\_APM\_products\_used.txt...

\*\*\*\*\*  
Getting IMM products list from 2007-06-21 00:00:00 to 2007-06-21 23:59:59...  
Writing file ./RESULTS/DAILY/070621/DATA\_SUMMARY/List\_IMM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/070621/DATA\_SUMMARY/List\_IMM\_products\_used.txt...

\*\*\*\*\*  
Getting WSM products list from 2007-06-21 00:00:00 to 2007-06-21 23:59:59...  
Writing file ./RESULTS/DAILY/070621/DATA\_SUMMARY/List\_WSM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/070621/DATA\_SUMMARY/List\_WSM\_products\_used.txt...

\*\*\*\*\*  
Getting MS products list from 2007-06-21 00:00:00 to 2007-06-21 23:59:59...  
Writing file ./RESULTS/DAILY/070621/DATA\_SUMMARY/List\_MS\_products\_used.xls...  
Writing file ./RESULTS/DAILY/070621/DATA\_SUMMARY/List\_MS\_products\_used.txt...

DATA SUMMARY completed  
#####

AUXILIARY FILES ANALYSIS

#####  
Analysis will be performed from 2007-06-21 00:00:00 to 2007-06-21 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/070621/AUXILIARY

Creating directory ./RESULTS/DAILY/070621/AUXILIARY...

\*\*\*\*\*  
Looking for the IECF operational ADFs list...



Found list 20070621\_030001\_current\_3\_IECF\_ADFs.txt...  
Extracting ADFs...

ASA\_CON\_AXVIEC20070410\_140202\_20070204\_165113\_20071231\_000000  
ASA\_INS\_AXVIEC20070306\_164819\_20070307\_060000\_20071231\_000000  
ASA\_XCH\_AXVIEC20051219\_162547\_20020301\_000000\_20081231\_000000  
ASA\_XCA\_AXVIEC20070517\_153558\_20070204\_165113\_20071231\_000000

Writing file ./RESULTS/DAILY/070621/AUXILIARY/ASAR\_ADFs\_IECF\_List3.html...  
Writing file ./RESULTS/DAILY/070621/AUXILIARY/Auxiliary\_files\_summary.html...

\*\*\*\*\*  
Analysing WVS products...

Writing file ./RESULTS/DAILY/070621/AUXILIARY/Check\_ADFs\_WVS.xls...  
Writing file ./RESULTS/DAILY/070621/AUXILIARY/Check\_ADFs\_WVS.txt...

ASA_WVS_1PNPDE20070621_003343_000010062059_00131_27740_6690.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_005747_000003302059_00131_27740_6697.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_012059_000002842059_00131_27740_6707.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_012444_000003452059_00131_27740_6821.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_013939_000005542059_00132_27741_6828.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_022240_000008992059_00132_27741_6840.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_023724_000003302059_00132_27741_6975.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_030254_000001502059_00132_27741_6972.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_032123_000000742059_00133_27742_6996.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_040321_000010042059_00133_27742_7014.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_041936_000001042059_00133_27742_7158.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_042435_000000452059_00133_27742_7161.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_044213_000012742059_00133_27742_7182.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_054236_000010342059_00134_27743_7192.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_203847_000018442059_00143_27752_7677.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_212811_000002402059_00143_27752_7685.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_213111_000002402059_00143_27752_7795.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_214122_000002542059_00143_27752_7798.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_215936_000001802059_00144_27753_7803.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_221736_0000020542059_00144_27753_7810.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_231005_000002542059_00144_27753_7813.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_231320_000013342059_00144_27753_7946.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070621_233710_000003452059_00145_27754_7949.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_055921_000004052059_00134_27743_6986.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_062247_000019642059_00134_27743_6999.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_074009_000003902059_00135_27744_7071.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_080323_000012742059_00135_27744_7074.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_082630_000006742059_00136_27745_7140.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_091123_000009442059_00136_27745_7208.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_094359_000019942059_00136_27745_7265.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_104910_000011092059_00137_27746_7336.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_112426_000018592059_00137_27746_7347.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_121424_000010642059_00138_27747_7440.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_124132_000004052059_00138_27747_7443.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_130511_000001952059_00138_27747_7446.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_131916_000007022059_00138_27747_7478.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_135818_000006442059_00139_27748_7600.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_141923_000005702059_00139_27748_7605.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_144547_000003752059_00139_27748_7610.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_145636_000004642059_00139_27748_7617.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_154506_000000892059_00140_27749_7766.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_154942_000001342059_00140_27749_7771.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_155410_000009292059_00140_27749_7776.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_162623_000011392059_00140_27749_7785.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_172632_000014242059_00141_27750_7904.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_181046_000010192059_00141_27750_7920.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_190001_000017392059_00142_27751_8028.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_194735_00000902059_00142_27751_8025.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070621_195223_000003442059_00142_27751_8040.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

\*\*\*\*\*

Analysing GM1 products...

Writing file ./RESULTS/DAILY/070621/AUXILIARY/Check\_ADFs\_GM1.xls...

Writing file ./RESULTS/DAILY/070621/AUXILIARY/Check\_ADFs\_GM1.txt...

ASA_GM1_1PNPDE20070621_002038_000006462059_00131_27740_6687.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_005121_000003862059_00131_27740_6692.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_010839_000002892059_00131_27740_6694.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_011811_000001692059_00131_27740_6704.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_013114_000005012059_00131_27740_6823.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_015212_000001022059_00132_27741_6825.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_015937_0000010382059_00132_27741_6902.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_024725_000005072059_00132_27741_6983.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_025645_000000782059_00132_27741_6981.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_030608_000001632059_00132_27741_6979.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_030900_000007372059_00132_27741_6977.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_032813_000005012059_00133_27742_6993.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_033757_000000782059_00133_27742_6985.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_034009_0000010032059_00133_27742_7088.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_042613_000004472059_00133_27742_7163.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_050412_000003562059_00134_27743_7167.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_051133_000000722059_00134_27743_7169.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_051548_000001322059_00134_27743_7177.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_051924_000004592059_00134_27743_7179.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_053126_000003502059_00134_27743_7189.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_202114_000007372059_00143_27752_7674.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_203617_000001442059_00143_27752_7672.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_211800_000006102059_00143_27752_7687.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_214620_000004592059_00144_27753_7800.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_221505_000001502059_00144_27753_7805.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_225248_000002592059_00144_27753_7807.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_225955_000002592059_00144_27753_7820.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20070621_234824_000007852059_00145_27754_7951.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_060649_000003022059_00134_27743_6983.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_062059_000001082059_00134_27743_6994.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_065615_000005072059_00135_27744_6996.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_070625_000002052059_00135_27744_7006.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_070908_000004652059_00135_27744_7064.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_072751_000003802059_00135_27744_7066.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_073833_000000962059_00135_27744_7068.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_074841_000008822059_00135_27744_7076.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_083835_000004042059_00136_27745_7078.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_084701_000002412059_00136_27745_7084.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_085025_000001572059_00136_27745_7199.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_090216_000002052059_00136_27745_7201.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_090959_000000842059_00136_27745_7203.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_092801_000001262059_00136_27745_7205.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_093715_000004042059_00136_27745_7210.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_101805_000001082059_00137_27746_7212.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_102338_000002172059_00137_27746_7267.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_104327_000003442059_00137_27746_7333.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_110837_000002052059_00137_27746_7338.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_115754_000003982059_00138_27747_7402.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_124912_000009242059_00138_27747_7466.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_133154_000009902059_00139_27748_7552.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_134747_000004772059_00139_27748_7597.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_140948_000002532059_00139_27748_7595.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_141548_000002112059_00139_27748_7602.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_142948_000009242059_00139_27748_7607.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_145253_000002232059_00139_27748_7612.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_150919_000001992059_00140_27749_7614.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_151524_000003262059_00140_27749_7624.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_153300_000001082059_00140_27749_7763.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_153932_000003322059_00140_27749_7768.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

```
ASA_GM1_1PNPDK20070621_154724_000001382059_00140_27749_7773.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_161024_000009242059_00140_27749_7778.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_164608_000002292059_00141_27750_7780.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_165321_000001812059_00141_27750_7782.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_165817_000001872059_00141_27750_7792.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_171707_000002352059_00141_27750_7891.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_172209_000002592059_00141_27750_7899.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_175100_000001262059_00141_27750_7901.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_175750_000005492059_00141_27750_7908.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_182834_000000962059_00142_27751_7906.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_183136_000002292059_00142_27751_7910.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_183853_000001872059_00142_27751_7917.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_184057_000001752059_00142_27751_8016.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_185641_000001992059_00142_27751_8020.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_193725_000000962059_00142_27751_8018.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_194046_000004042059_00142_27751_8022.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_200040_000007372059_00142_27751_8030.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070621_201709_000001022059_00143_27752_8042.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

\*\*\*\*\*

Analysing APM products...

Writing file ./RESULTS/DAILY/070621/AUXILIARY/Check\_ADFs\_APM.xls...

Writing file ./RESULTS/DAILY/070621/AUXILIARY/Check\_ADFs\_APM.txt...

```
ASA_APM_1PNPDE20070621_072533_000001112059_00135_27744_7342.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20070621_085857_000000412059_00136_27745_7349.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20070621_104038_000000422059_00137_27746_7401.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20070621_150455_000000712059_00140_27749_7578.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20070621_165625_000000852059_00141_27750_7580.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

\*\*\*\*\*

Analysing IMM products...

Writing file ./RESULTS/DAILY/070621/AUXILIARY/Check\_ADFs\_IMM.xls...

Writing file ./RESULTS/DAILY/070621/AUXILIARY/Check\_ADFs\_IMM.txt...

```
ASA_IMM_1PNPDE20070621_001403_000003782059_00131_27740_6910.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_003246_000000502059_00131_27740_6783.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_021653_000000822059_00132_27741_6931.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_021924_000000502059_00132_27741_6914.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_022058_000000952059_00132_27741_6929.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_025552_000000362059_00132_27741_6924.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_033916_000000352059_00133_27742_7123.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_035654_000001812059_00133_27742_7147.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_051010_000000662059_00134_27743_7264.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_051248_000000362059_00134_27743_7254.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_051440_000000502059_00134_27743_7260.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_053715_000002602059_00134_27743_7279.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_090054_000000612059_00136_27745_7351.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_115605_000000502059_00138_27747_7458.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_171229_000000372059_00141_27750_7591.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_172102_000000512059_00141_27750_7595.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070621_201300_000000352059_00143_27752_7670.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20070621_082520_000000602059_00136_27745_7166.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20070621_102718_000000362059_00137_27746_7214.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20070621_121326_000000512059_00138_27747_7422.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20070621_201850_000000362059_00143_27752_8032.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20070621_220311_000000662059_00144_27753_8129.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

\*\*\*\*\*

Analysing WSM products...



Writing file ./RESULTS/DAILY/070621/AUXILIARY/Check\_ADFs\_WSM.xls...  
 Writing file ./RESULTS/DAILY/070621/AUXILIARY/Check\_ADFs\_WSM.txt...

ASA_WSM_1PNPDE20070621_010411_000002442059_00131_27740_6804.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_011337_000002632059_00131_27740_6908.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_014938_000001282059_00132_27741_6912.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_015403_000003242059_00132_27741_7108.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_024351_000002022059_00132_27741_6969.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_025813_000002812059_00132_27741_7149.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_032329_000002752059_00133_27742_7262.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_040019_000001842059_00133_27742_7165.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_043349_000005002059_00133_27742_7384.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_043456_000004342059_00133_27742_7320.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_070451_000000852059_00135_27744_7353.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_070558_000000182059_00135_27744_7316.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_071705_000004762059_00135_27744_7386.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_073419_000002442059_00135_27744_7484.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_090553_000002392059_00136_27745_7388.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_093015_000004092059_00136_27745_7478.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_102004_000002012059_00137_27746_7512.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_102111_000001332059_00137_27746_7444.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_111211_000002632059_00137_27746_7447.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_111713_000003852059_00137_27746_7518.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_123257_000002442059_00138_27747_7514.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_123257_000004702059_00138_27747_7540.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_123803_000001632059_00138_27747_7515.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_141415_000000852059_00139_27748_7566.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_150645_000001472059_00140_27749_7582.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_151249_000001412059_00140_27749_7593.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_165009_000001832059_00141_27750_7585.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_170935_000001162059_00141_27750_7587.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_171353_000001832059_00141_27750_7627.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_171500_000001152059_00141_27750_7621.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_175316_000002612059_00141_27750_7632.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_183021_000000672059_00142_27751_7664.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_184936_000002322059_00142_27751_7634.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_185404_000001462059_00142_27751_7668.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_192952_000004462059_00142_27751_7774.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_193913_000000852059_00142_27751_7636.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_195857_000000912059_00142_27751_7666.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_203340_000001462059_00143_27752_7792.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_211027_000004462059_00143_27752_7899.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_220825_000003912059_00144_27753_8048.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_225721_000001462059_00144_27753_7894.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_230424_000003422059_00144_27753_7958.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_234338_000001292059_00145_27754_8370.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070621_234446_000000612059_00145_27754_7941.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070621_061203_000005242059_00134_27743_7062.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070621_102907_000002632059_00137_27746_7323.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070621_103351_000002752059_00137_27746_7331.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070621_120441_000005242059_00138_27747_7562.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070621_130914_000006052059_00138_27747_7593.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070621_152101_000000852059_00140_27749_7714.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070621_152251_000005932059_00140_27749_7761.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070621_170135_000005812059_00141_27750_7889.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070621_184404_000003912059_00142_27751_8014.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070621_201940_000000852059_00143_27752_8114.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070621_220503_000002692059_00144_27753_8141.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070621_234415_000002392059_00145_27754_8151.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

AUXILIARY FILES ANALYSIS completed  
 #####

MODULE STEPPING ANALYSIS

#####

Analysis will be performed from 2007-06-21 00:00:00 to 2007-06-21 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/070621/MODULE\_STEPPING

Creating directory ./RESULTS/DAILY/070621/MODULE\_STEPPING...  
Creating directory ./RESULTS/DAILY/070621/MODULE\_STEPPING/FIRST\_REFERENCE...  
Creating directory ./RESULTS/DAILY/070621/MODULE\_STEPPING/SECOND\_REFERENCE...  
Creating directory ./RESULTS/DAILY/070621/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE...  
Deleting old files...

\*\*\*\*\*  
\*\*\*\*\*

Creating images comparing with second reference...

Exporting results to the directory ../../RESULTS/DAILY/070621/MODULE\_STEPPING/SECOND\_REFERENCE...

Polarization: H  
Reference product: ASA\_MS\_\_0PNPDK20050922\_062651\_000000152041\_00034\_18625\_0041.N1  
Test product: ASA\_MS\_\_0PNPDK20070620\_081854\_000000162059\_00121\_27730\_0315.N1

H  
H  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/SECOND\_REFERENCE/TGH\_20070620\_081854-20050922\_062651.png  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/SECOND\_REFERENCE/TPH\_20070620\_081854-20050922\_062651.png  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/SECOND\_REFERENCE/RGH\_20070620\_081854-20050922\_062651.png  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/SECOND\_REFERENCE/RPH\_20070620\_081854-20050922\_062651.png

Polarization: V  
Reference product: ASA\_MS\_\_0PNPDK20050923\_055514\_000000152041\_00048\_18639\_0042.N1  
Test product: ASA\_MS\_\_0PNPDK20070621\_074717\_000000162059\_00135\_27744\_0316.N1

V  
V  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/SECOND\_REFERENCE/TGV\_20070621\_074717-20050923\_055514.png  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/SECOND\_REFERENCE/TPV\_20070621\_074717-20050923\_055514.png  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/SECOND\_REFERENCE/RGV\_20070621\_074717-20050923\_055514.png  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/SECOND\_REFERENCE/RPV\_20070621\_074717-20050923\_055514.png

\*\*\*\*\*  
\*\*\*\*\*

Creating images comparing with previous product reference...

Exporting results to the directory ../../RESULTS/DAILY/070621/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE...

Polarization: H  
Reference product: ASA\_MS\_\_0PNPDK20070618\_092208\_000000162059\_00093\_27702\_0313.N1  
Test product: ASA\_MS\_\_0PNPDK20070620\_081854\_000000162059\_00121\_27730\_0315.N1

H  
H  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TGH\_20070620\_081854-20070618\_092208.png  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TPH\_20070620\_081854-20070618\_092208.png  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RGH\_20070620\_081854-20070618\_092208.png  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RPH\_20070620\_081854-20070618\_092208.png

Polarization: V  
Reference product: ASA\_MS\_\_0PNPDK20070619\_085031\_000000162059\_00107\_27716\_0314.N1  
Test product: ASA\_MS\_\_0PNPDK20070621\_074717\_000000162059\_00135\_27744\_0316.N1

V  
V  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TGV\_20070621\_074717-20070619\_085031.png  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TPV\_20070621\_074717-20070619\_085031.png  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RGV\_20070621\_074717-20070619\_085031.png  
../../RESULTS/DAILY/070621/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RPV\_20070621\_074717-20070619\_085031.png

MODULE\_STEPPING ANALYSIS completed

#####



CALIBRATION PULSES ANALYSIS

#####

Creating directory ./RESULTS/DAILY/070621/CALIBRATION\_PULSES...

\*\*\*\*\*  
\*\*\*\*\*

ALL ROWS Analysis will be performed from 2007-06-21 00:00:00 to 2007-06-21 23:59:59

Analysing products WVS IS2 V/V

Writing image ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Calibration\_pulses\_all\_rows\_WVS\_IS2\_VV.png...

Analysing products GM1 SS3 H/H

Writing image ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Calibration\_pulses\_all\_rows\_GM1\_SS3\_HH.png...

\*\*\*\*\*  
\*\*\*\*\*

TEMPORAL EVOLUTION Analysis will be performed from 2007-06-21 00:00:00 to 2007-06-21 23:59:59

Analysing products WVS IS2 V/V

Getting calibration pulses data for WVS IS2 V/V from 2007-06-21 00:00:00 to 2007-06-21 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/070621/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2007-06-21\_1.dat...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_1.png...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2007-06-21 00:00:00 to 2007-06-21 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/070621/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2007-06-21\_2.dat...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_2.png...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2007-06-21 00:00:00 to 2007-06-21 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/070621/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2007-06-21\_3.dat...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_3.png...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2007-06-21 00:00:00 to 2007-06-21 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/070621/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2007-06-21\_4.dat...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_4.png...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_4.png...

Analysing products GM1 SS3 H/H

Getting calibration pulses data for GM1 SS3 H/H from 2007-06-21 00:00:00 to 2007-06-21 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/070621/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2007-06-21\_1.dat...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_1.png...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_1.png...

Getting calibration pulses data for GM1 SS3 H/H from 2007-06-21 00:00:00 to 2007-06-21 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/070621/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2007-06-21\_2.dat...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_2.png...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2007-06-21 00:00:00 to 2007-06-21 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/070621/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2007-06-21\_3.dat...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_3.png...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2007-06-21 00:00:00 to 2007-06-21 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/070621/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2007-06-21\_4.dat...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_4.png...

Writing ../../RESULTS/DAILY/070621//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_4.png...

CALIBRATION PULSES ANALYSIS completed

#####

DOPPLER ANALYSIS

#####

Creating directory ./RESULTS/DAILY/070621/DOPPLER...

\*\*\*\*\*  
\*\*\*\*\*

DOPPLER ANX Analysis will be performed from 2007-06-21 00:00:00 to 2007-06-21 23:59:59

Analysing products WVS IS2 V/V

Getting doppler data for WVS IS2 V/V from 2007-06-21 00:00:00 to 2007-06-21 23:59:59...

Writing file ./RESULTS/DAILY/070621/DOPPLER/Doppler\_data\_WVS\_IS2\_VV\_2007-06-21.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/070621/DOPPLER/DOPPLER\_ANX\_WVS\_IS2\_VV.png...

Analysing products GM1 SS1 H/H

Getting doppler data for GM1 SS1 H/H from 2007-06-21 00:00:00 to 2007-06-21 23:59:59...

Writing file ./RESULTS/DAILY/070621/DOPPLER/Doppler\_data\_GM1\_SS1\_HH\_2007-06-21.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/070621/DOPPLER/DOPPLER\_ANX\_GM1\_SS1\_HH.png...

\*\*\*\*\*  
\*\*\*\*\*

DOPPLER JUMPS Analysis will be performed on WSM products from 2007-06-21 00:00:00 to 2007-06-21 23:59:59

Analysing by default products WSM

Getting doppler jumps data for WSM from 2007-06-21 00:00:00 to 2007-06-21 23:59:59...

Writing file ./RESULTS/DAILY/070621/DOPPLER/Doppler\_Jumps\_data\_WSM\_2007-06-21.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/070621/DOPPLER/DOPPLER\_JUMPS\_ANX\_WSM.png...

Writing file ../../RESULTS/DAILY/070621/DOPPLER/DOPPLER\_JUMPS\_Date\_WSM.png...

\*\*\*\*\*  
\*\*\*\*\*

DOPPLER MAP Analysis will be performed from 2007-06-21 00:00:00 to 2007-06-21 23:59:59

Analysing products WVS IS2 V/V

Loading predicted doppler values....

Phase: descending

Found data...

Computing mean error doppler estimated-predicted...

Mean error = -16.972490 Hz

Writing file ../../RESULTS/DAILY/070621//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_WVS\_IS2\_VV\_desc.jpg...

Writing file ../../RESULTS/DAILY/070621//DOPPLER/DOPPLER\_Absolute\_WVS\_IS2\_VV\_desc.jpg...

\*\*\*\*\*

Loading predicted doppler values....

Phase: ascending

Found data...

Computing mean error doppler estimated-predicted...

Mean error = -10.411567 Hz

Writing file ../../RESULTS/DAILY/070621//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_WVS\_IS2\_VV\_asc.jpg...

Writing file ../../RESULTS/DAILY/070621//DOPPLER/DOPPLER\_Absolute\_WVS\_IS2\_VV\_asc.jpg...

\*\*\*\*\*

```
Analysing products GM1 SS1 H/H
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -18.768826 Hz
Writing file ../../RESULTS/DAILY/070621//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_desc.jpg...
Writing file ../../RESULTS/DAILY/070621//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_desc.jpg...
```

```
*****
Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -23.696402 Hz
Writing file ../../RESULTS/DAILY/070621//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_asc.jpg...
Writing file ../../RESULTS/DAILY/070621//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_asc.jpg...
```

\*\*\*\*\*

```
DOPPLER ANALYSIS completed
#####
```

```
CHIRP ANALYSIS
#####
Creating directory ./RESULTS/DAILY/070621/CHIRP...
```

```
*****
*****
CHIRP Analysis will be performed from 2007-06-21 00:00:00 to 2007-06-21 23:59:59
```

```
Analysing products WSM SS1
*****
Getting ScaleFactor data for WSM SS1 from 2007-06-21 00:00:00 to 2007-06-21 23:59:59...
Writing file ./RESULTS/DAILY/070621/CHIRP/ScaleFactor_data_WSM_SS1_2007-06-21.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/070621/CHIRP/ScaleFactor_ANX_WSM_SS1_.png...
Writing file ../../RESULTS/DAILY/070621/CHIRP/ScaleFactor_DATE_WSM_SS1_.png...
```

```
CHIRP ANALYSIS completed
#####
```

```
RAW DATA ANALYSIS
#####
Analysis will be performed from 2007-06-21 00:00:00 to 2007-06-21 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/070621/RAW_DATA
```

```
Creating directory ./RESULTS/DAILY/070621/RAW_DATA...
```

```
*****
Getting raw data for WVS from 2007-06-21 00:00:00 to 2007-06-21 23:59:59...
Writing file ./RESULTS/DAILY/070621/RAW_DATA/Raw_data_WVS_2007-06-21.dat...
Running IDL program to create graphs...
```

```
Creating image ../../RESULTS/DAILY/070621/RAW_DATA/Raw_data_WVS_input_mean.png...
Creating image ../../RESULTS/DAILY/070621/RAW_DATA/Raw_data_WVS_input_stdev.png...
Creating image ../../RESULTS/DAILY/070621/RAW_DATA/Raw_data_WVS_gain_imbalance.png...
```

\*\*\*\*\*

Getting raw data for IMM from 2007-06-21 00:00:00 to 2007-06-21 23:59:59...  
Writing file ./RESULTS/DAILY/070621/RAW\_DATA/Raw\_data\_IMM\_2007-06-21.dat...  
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/070621/RAW\_DATA/Raw\_data\_IMM\_input\_mean.png...  
Creating image ../../RESULTS/DAILY/070621/RAW\_DATA/Raw\_data\_IMM\_input\_stdev.png...  
Creating image ../../RESULTS/DAILY/070621/RAW\_DATA/Raw\_data\_IMM\_gain\_imbalance.png...

RAW DATA ANALYSIS completed

#####

TELEMETRY ANALYSIS

#####

Analysis will be performed from 2007-06-21 00:00:00 to 2007-06-21 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/070621/TELEMETRY

Creating directory ./RESULTS/DAILY/070621/TELEMETRY...

Looking for gaps and missing lines in WVS products...

\*\*\*\*\*

Checking 24 products from PDE...

Checking 26 products from PDK...

Looking for gaps and missing lines in GM1 products...

\*\*\*\*\*

Checking 28 products from PDE...

Checking 49 products from PDK...

Looking for gaps and missing lines in APM products...

\*\*\*\*\*

Checking 5 products from PDE...

No products from PDK...

Looking for gaps and missing lines in IMM products...

\*\*\*\*\*

Checking 17 products from PDE...

Checking 5 products from PDK...

Looking for gaps and missing lines in WSM products...

\*\*\*\*\*

Checking 44 products from PDE...

Found product...ASA\_WSM\_1PNPDE20070621\_032329\_000002752059\_00133\_27742\_7262.N1 / 0 gaps / 66 missing lines

Checking 12 products from PDK...

Creating graph of missing lines and gaps...

\*\*\*\*\*

Creating image: ./RESULTS/DAILY/070621/TELEMETRY/TELEMETRY\_Missing\_lines.png...

Creating image: ./RESULTS/DAILY/070621/TELEMETRY/TELEMETRY\_Gaps.png...

TELEMETRY ANALYSIS completed

#####

BROWSE PRODUCTS ANALYSIS

#####

Analysis will be performed on 2007-06-21

\*\*\*\*\*

Scanning directory /nas3/ENVISAT/ASAR//ASA\_GM\_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA\_GM\_BP/JPG/20070621/



ANALYSIS COMPLETED: 0 GM browse products to see...  
\*\*\*\*\*

\*\*\*\*\*  
Scanning directory /nas3/ENVISAT/ASAR//ASA\_AP\_BP...  
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA\_AP\_BP/JPG/20070621/

Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20070621\_150455\_000000712059\_00140\_27749\_7579.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20070621\_165625\_000000852059\_00141\_27750\_7581.N1 ...

ANALYSIS COMPLETED: 2 AP browse products to see...  
\*\*\*\*\*

\*\*\*\*\*  
Scanning directory /nas3/ENVISAT/ASAR//ASA\_IM\_BP...  
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA\_IM\_BP/JPG/20070621/

ANALYSIS COMPLETED: 0 IM browse products to see...  
\*\*\*\*\*

\*\*\*\*\*  
Scanning directory /nas3/ENVISAT/ASAR//ASA\_WS\_BP...  
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA\_WS\_BP/JPG/20070621/

Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_073419\_000002442059\_00135\_27744\_7485.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_093015\_000004092059\_00136\_27745\_7479.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_102004\_000002012059\_00137\_27746\_7513.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_111713\_000003852059\_00137\_27746\_7519.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_123257\_000002442059\_00138\_27747\_7516.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_123257\_000004702059\_00138\_27747\_7541.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_123803\_000001632059\_00138\_27747\_7517.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_141415\_000000852059\_00139\_27748\_7567.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_150645\_000001472059\_00140\_27749\_7583.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_151249\_000001412059\_00140\_27749\_7594.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_165009\_000001832059\_00141\_27750\_7586.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_170935\_000001162059\_00141\_27750\_7588.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_171353\_000001832059\_00141\_27750\_7628.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_171500\_000001152059\_00141\_27750\_7622.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_175316\_000002612059\_00141\_27750\_7633.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_183021\_000000672059\_00142\_27751\_7665.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_184936\_000002322059\_00142\_27751\_7635.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_185404\_000001462059\_00142\_27751\_7669.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_192952\_000004462059\_00142\_27751\_7775.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_193913\_000000852059\_00142\_27751\_7637.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_195857\_000000912059\_00142\_27751\_7667.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_203340\_000001462059\_00143\_27752\_7793.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_211027\_000004462059\_00143\_27752\_7900.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_220825\_000003912059\_00144\_27753\_8049.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_225721\_000001462059\_00144\_27753\_7895.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_230424\_000003422059\_00144\_27753\_7959.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20070621\_234446\_000000612059\_00145\_27754\_7942.N1 ...

ANALYSIS COMPLETED: 27 WS browse products to see...  
\*\*\*\*\*

BROWSE PRODUCTS ANALYSIS completed  
#####

HTML REPORT generation  
#####

Building file ./RESULTS/DAILY/070621/asarReport.html...  
Building DATA SUMMARY section...

Building AUXILIARY FILES ANALYSIS section...  
Building MODULE STEPPING ANALYSIS section...  
Building CALIBRATION PULSES ANALYSIS section...  
Building DOPPLER ANALYSIS section...  
Building CHIRP ANALYSIS section...  
Building RAW DATA ANALYSIS section...  
Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed

#####



# ASAR Daily Report



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20070621_072533_000001112059_00135_27744_7342.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20070621_085857_000000412059_00136_27745_7349.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20070621_104038_000000422059_00137_27746_7401.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20070621_150455_000000712059_00140_27749_7578.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20070621_165625_000000852059_00141_27750_7580.N1	OK	OK	OK	OK



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20070621_002038_000006462059_00131_27740_6687.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_005121_000003862059_00131_27740_6692.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_010839_000002892059_00131_27740_6694.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_011811_000001692059_00131_27740_6704.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_013114_000005012059_00131_27740_6823.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_015212_000001022059_00132_27741_6825.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_015937_000010382059_00132_27741_6902.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_024725_000005072059_00132_27741_6983.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_025645_000000782059_00132_27741_6981.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_030608_000001632059_00132_27741_6979.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_030900_000007372059_00132_27741_6977.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_032813_000005012059_00133_27742_6993.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_033757_000000782059_00133_27742_6985.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_034009_000010032059_00133_27742_7088.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_042613_000004472059_00133_27742_7163.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_050412_000003562059_00134_27743_7167.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_051133_000000722059_00134_27743_7169.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_051548_000001322059_00134_27743_7177.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_051924_000004592059_00134_27743_7179.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_053126_000003502059_00134_27743_7189.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_202114_000007372059_00143_27752_7674.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_203617_000001442059_00143_27752_7672.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_211800_000006102059_00143_27752_7687.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_214620_000004592059_00144_27753_7800.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_221505_000001502059_00144_27753_7805.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_225248_000002592059_00144_27753_7807.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_225955_000002592059_00144_27753_7820.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070621_234824_000007852059_00145_27754_7951.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_060649_000003022059_00134_27743_6983.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_062059_000001082059_00134_27743_6994.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_065615_000005072059_00135_27744_6996.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_070625_000002052059_00135_27744_7006.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_070908_000004652059_00135_27744_7064.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_072751_000003802059_00135_27744_7066.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_073833_000000962059_00135_27744_7068.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_074841_000008822059_00135_27744_7076.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_083835_000004042059_00136_27745_7078.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_084701_000002412059_00136_27745_7084.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_085025_000001572059_00136_27745_7199.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_090216_000002052059_00136_27745_7201.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_090959_000000842059_00136_27745_7203.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_092801_000001262059_00136_27745_7205.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_093715_000004042059_00136_27745_7210.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_101805_000001082059_00137_27746_7212.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_102338_000002172059_00137_27746_7267.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_104327_000003442059_00137_27746_7333.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_110837_000002052059_00137_27746_7338.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_115754_000003982059_00138_27747_7402.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_124912_000009242059_00138_27747_7466.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_133154_000009902059_00139_27748_7552.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_134747_000004772059_00139_27748_7597.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_140948_000002532059_00139_27748_7595.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_141548_000002112059_00139_27748_7602.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_142948_000009242059_00139_27748_7607.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_145253_000002232059_00139_27748_7612.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_150919_000001992059_00140_27749_7614.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_151524_000003262059_00140_27749_7624.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_153300_000001082059_00140_27749_7763.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_153932_000003322059_00140_27749_7768.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_154724_000001382059_00140_27749_7773.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_161024_000009242059_00140_27749_7778.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_164608_000002292059_00141_27750_7780.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_165321_000001812059_00141_27750_7782.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_165817_000001872059_00141_27750_7792.N1					OK	OK	OK	OK

ASA_GM1_1PNPDK20070621_171707_000002352059_00141_27750_7891.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_172209_000002592059_00141_27750_7899.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_175100_000001262059_00141_27750_7901.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_175750_000005492059_00141_27750_7908.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_182834_000000962059_00142_27751_7906.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_183136_000002292059_00142_27751_7910.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_183853_000001872059_00142_27751_7917.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_184057_000001752059_00142_27751_8016.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_185641_000001992059_00142_27751_8020.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_193725_000000962059_00142_27751_8018.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_194046_000004042059_00142_27751_8022.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_200040_000007372059_00142_27751_8030.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070621_201709_000001022059_00143_27752_8042.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_IMM_1PNPDE20070621_001403_000003782059_00131_27740_6910.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_003246_000000502059_00131_27740_6783.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_021653_000000822059_00132_27741_6931.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_021924_000000502059_00132_27741_6914.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_022058_000000952059_00132_27741_6929.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_025552_000000362059_00132_27741_6924.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_033916_000000352059_00133_27742_7123.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_035654_000001812059_00133_27742_7147.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_051010_000000662059_00134_27743_7264.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_051248_000000362059_00134_27743_7254.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_051440_000000502059_00134_27743_7260.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_053715_000002602059_00134_27743_7279.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_090054_000000612059_00136_27745_7351.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_115605_000000502059_00138_27747_7458.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_171229_000000372059_00141_27750_7591.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_172102_000000512059_00141_27750_7595.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070621_201300_000000352059_00143_27752_7670.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20070621_082520_000000602059_00136_27745_7166.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20070621_102718_000000362059_00137_27746_7214.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20070621_121326_000000512059_00138_27747_7422.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20070621_201850_000000362059_00143_27752_8032.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20070621_220311_000000662059_00144_27753_8129.N1					OK	OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WSM_1PNPDE20070621_010411_000002442059_00131_27740_6804.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_011337_000002632059_00131_27740_6908.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_014938_000001282059_00132_27741_6912.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_015403_000003242059_00132_27741_7108.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_024351_000002022059_00132_27741_6969.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_025813_000002812059_00132_27741_7149.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_032329_000002752059_00133_27742_7262.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_040019_000001842059_00133_27742_7165.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_043349_000005002059_00133_27742_7384.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_043456_000004342059_00133_27742_7320.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_070451_000000852059_00135_27744_7353.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_070558_000000182059_00135_27744_7316.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_071705_000004762059_00135_27744_7386.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_073419_000002442059_00135_27744_7484.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_090553_000002392059_00136_27745_7388.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_093015_000004092059_00136_27745_7478.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_102004_000002012059_00137_27746_7512.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_102111_000001332059_00137_27746_7444.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_111211_000002632059_00137_27746_7447.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_111713_000003852059_00137_27746_7518.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_123257_000002442059_00138_27747_7514.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_123257_000004702059_00138_27747_7540.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_123803_000001632059_00138_27747_7515.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_141415_000000852059_00139_27748_7566.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_150645_000001472059_00140_27749_7582.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_151249_000001412059_00140_27749_7593.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_165009_000001832059_00141_27750_7585.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_170935_000001162059_00141_27750_7587.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_171353_000001832059_00141_27750_7627.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_171500_000001152059_00141_27750_7621.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_175316_000002612059_00141_27750_7632.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_183021_000000672059_00142_27751_7664.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_184936_000002322059_00142_27751_7634.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_185404_000001462059_00142_27751_7668.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_192952_000004462059_00142_27751_7774.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_193913_000000852059_00142_27751_7636.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_195857_000000912059_00142_27751_7666.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_203340_000001462059_00143_27752_7792.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_211027_000004462059_00143_27752_7899.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_220825_000003912059_00144_27753_8048.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_225721_000001462059_00144_27753_7894.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_230424_000003422059_00144_27753_7958.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_234338_000001292059_00145_27754_8370.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070621_234446_000000612059_00145_27754_7941.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070621_061203_000005242059_00134_27743_7062.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070621_102907_000002632059_00137_27746_7323.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070621_103351_000002752059_00137_27746_7331.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070621_120441_000005242059_00138_27747_7562.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070621_130914_000006052059_00138_27747_7593.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070621_152101_000000852059_00140_27749_7714.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070621_152251_000005932059_00140_27749_7761.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070621_170135_000005812059_00141_27750_7889.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070621_184404_000003912059_00142_27751_8014.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070621_201940_000000852059_00143_27752_8114.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070621_220503_000002692059_00144_27753_8141.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070621_234415_000002392059_00145_27754_8151.N1					OK	OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20070621_003343_000010062059_00131_27740_6690.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_005747_000003302059_00131_27740_6697.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_012059_000002842059_00131_27740_6707.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_012444_000003452059_00131_27740_6821.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_013939_000005542059_00132_27741_6828.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_022240_000008992059_00132_27741_6840.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_023724_000003302059_00132_27741_6975.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_030254_000001502059_00132_27741_6972.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_032123_000000742059_00133_27742_6996.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_040321_000010042059_00133_27742_7014.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_041936_000001042059_00133_27742_7158.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_042435_000000452059_00133_27742_7161.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_044213_000012742059_00133_27742_7182.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_054236_000010342059_00134_27743_7192.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_203847_000018442059_00143_27752_7677.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_212811_000002402059_00143_27752_7685.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_213111_000002402059_00143_27752_7795.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_214122_000002542059_00143_27752_7798.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_215936_000001802059_00144_27753_7803.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_221736_000020542059_00144_27753_7810.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_231005_000002542059_00144_27753_7813.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_231320_000013342059_00144_27753_7946.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070621_233710_000003452059_00145_27754_7949.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_055921_000004052059_00134_27743_6986.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_062247_000019642059_00134_27743_6999.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_074009_000003902059_00135_27744_7071.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_080323_000012742059_00135_27744_7074.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_082630_000006742059_00136_27745_7140.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_091123_000009442059_00136_27745_7208.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_094359_000019942059_00136_27745_7265.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_104910_000011092059_00137_27746_7336.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_112426_000018592059_00137_27746_7347.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_121424_000010642059_00138_27747_7440.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_124132_000004052059_00138_27747_7443.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_130511_000001952059_00138_27747_7446.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_131916_000007022059_00138_27747_7478.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_135818_000006442059_00139_27748_7600.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_141923_000005702059_00139_27748_7605.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_144547_000003752059_00139_27748_7610.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_145636_000004642059_00139_27748_7617.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_154506_000000892059_00140_27749_7766.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_154942_000001342059_00140_27749_7771.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_155410_000009292059_00140_27749_7776.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_162623_000011392059_00140_27749_7785.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_172632_000014242059_00141_27750_7904.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_181046_000010192059_00141_27750_7920.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_190001_000017392059_00142_27751_8028.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_194735_000000902059_00142_27751_8025.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070621_195223_000003442059_00142_27751_8040.N1					OK	OK	OK	OK


### Calibration pulses for GM1 SS3 H/H

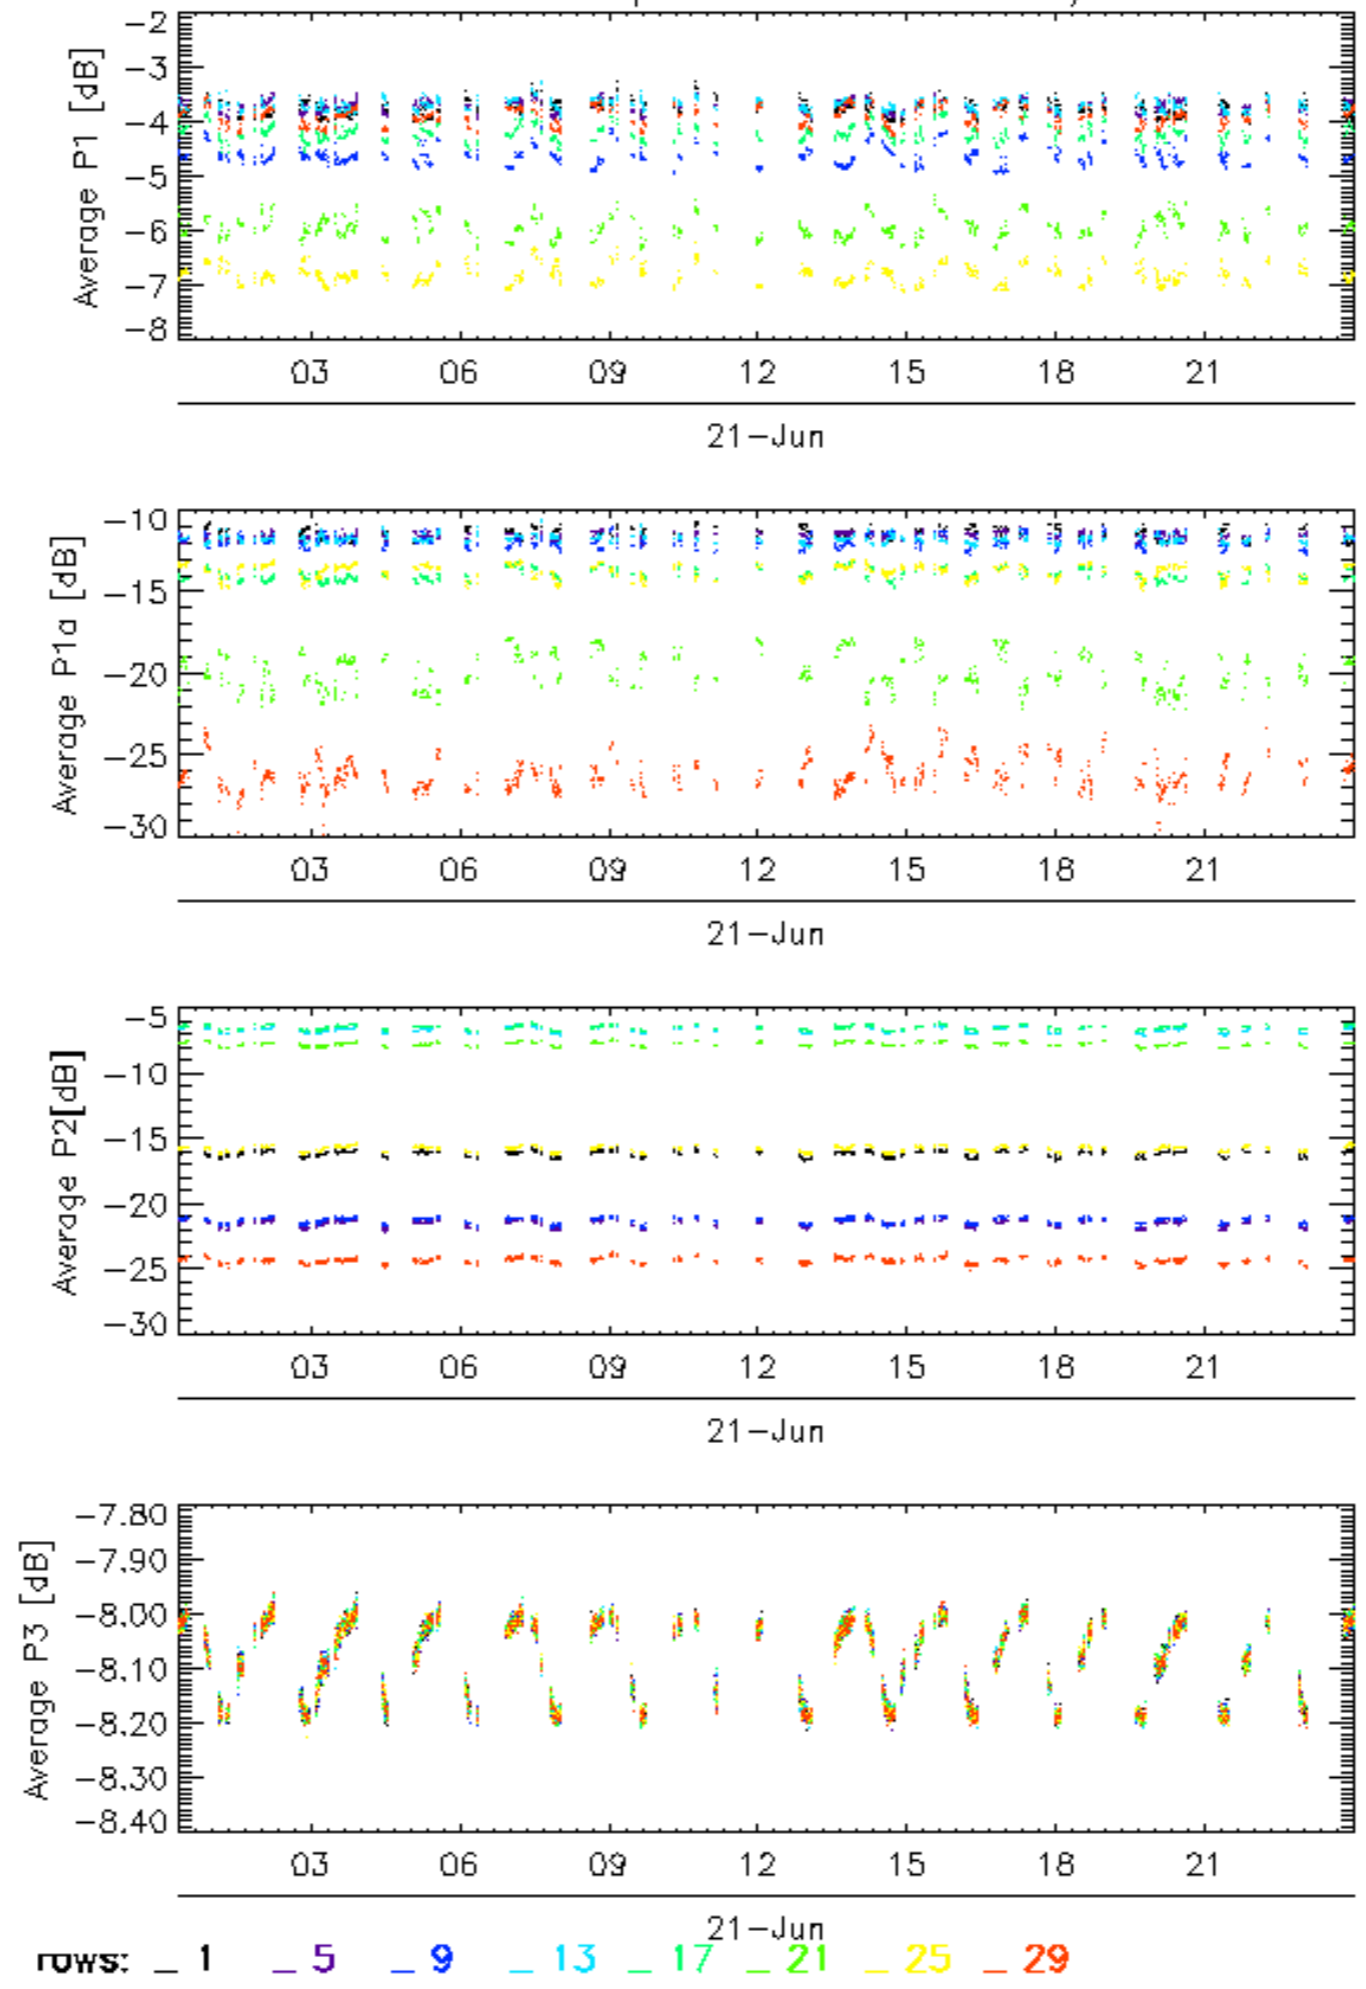

### Calibration pulses for GM1 SS3 H/H

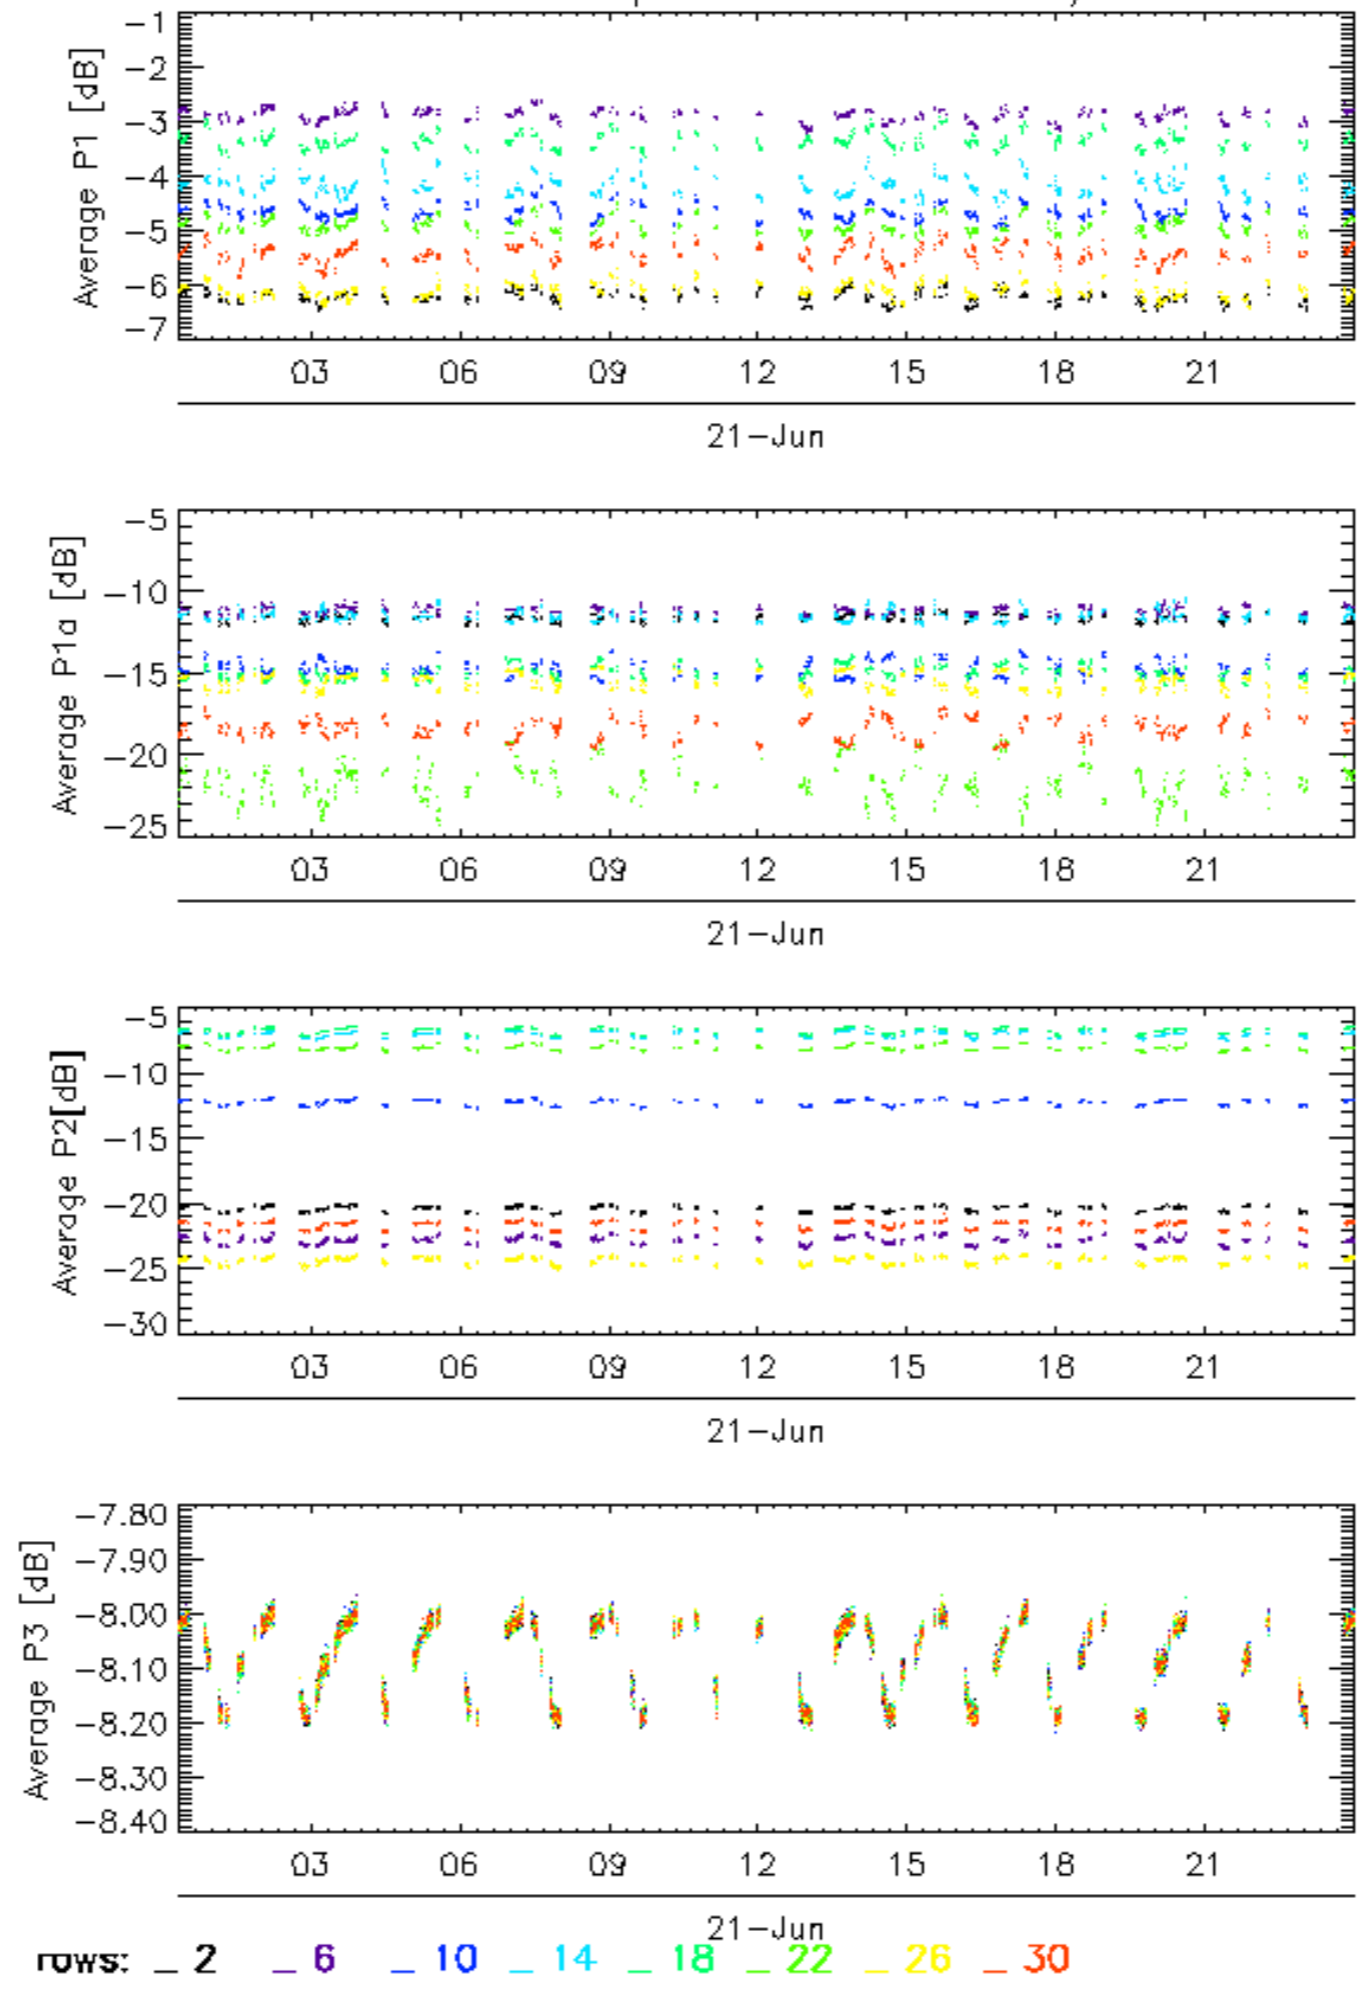


### Calibration pulses for GM1 SS3 H/H

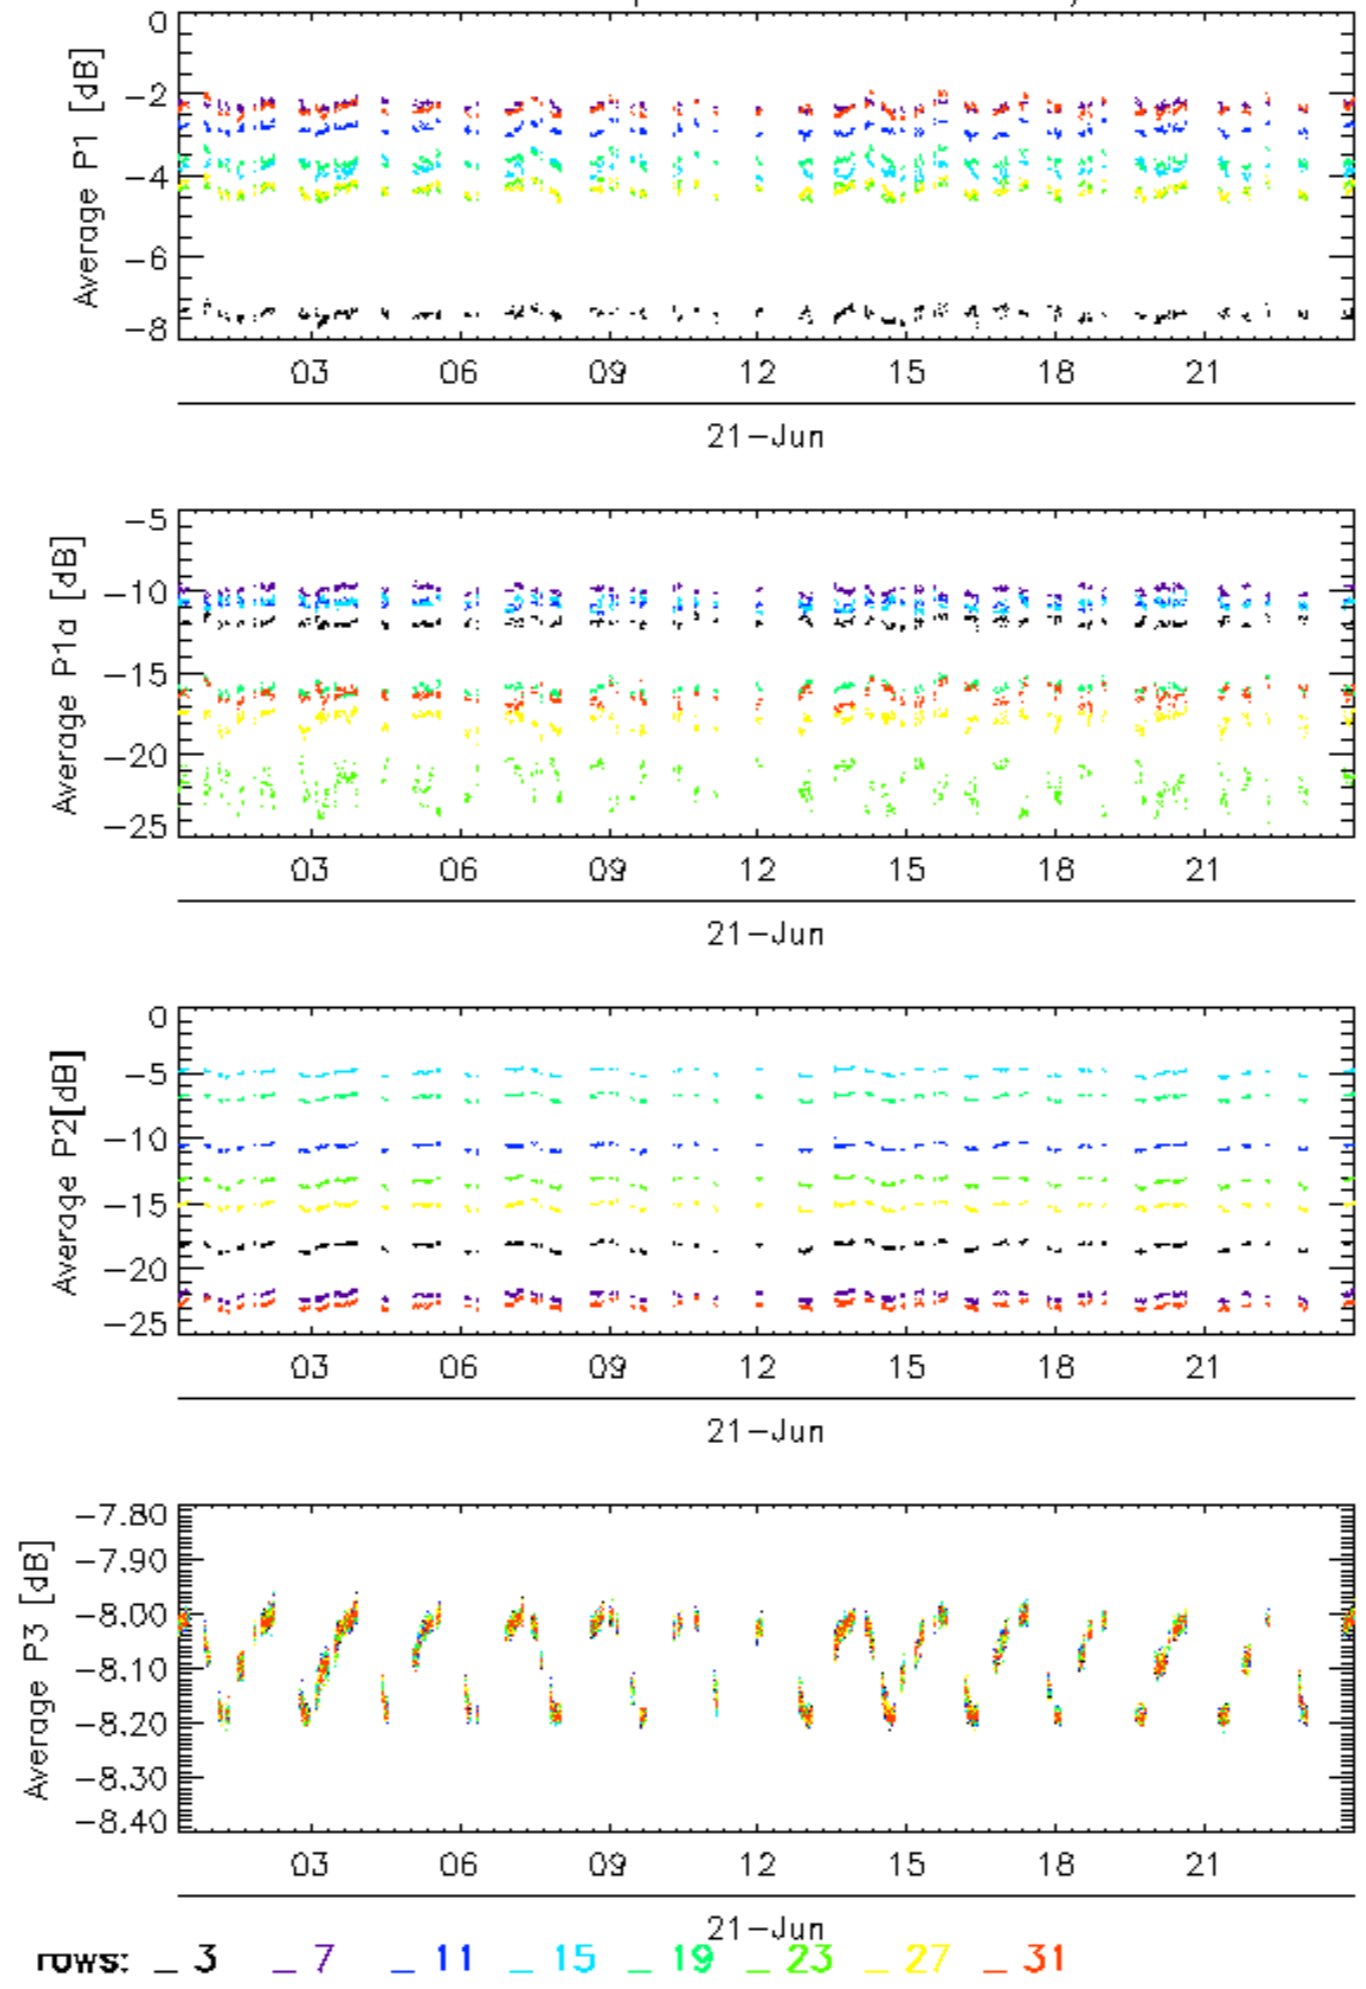





### Calibration pulses for GM1 SS3 H/H

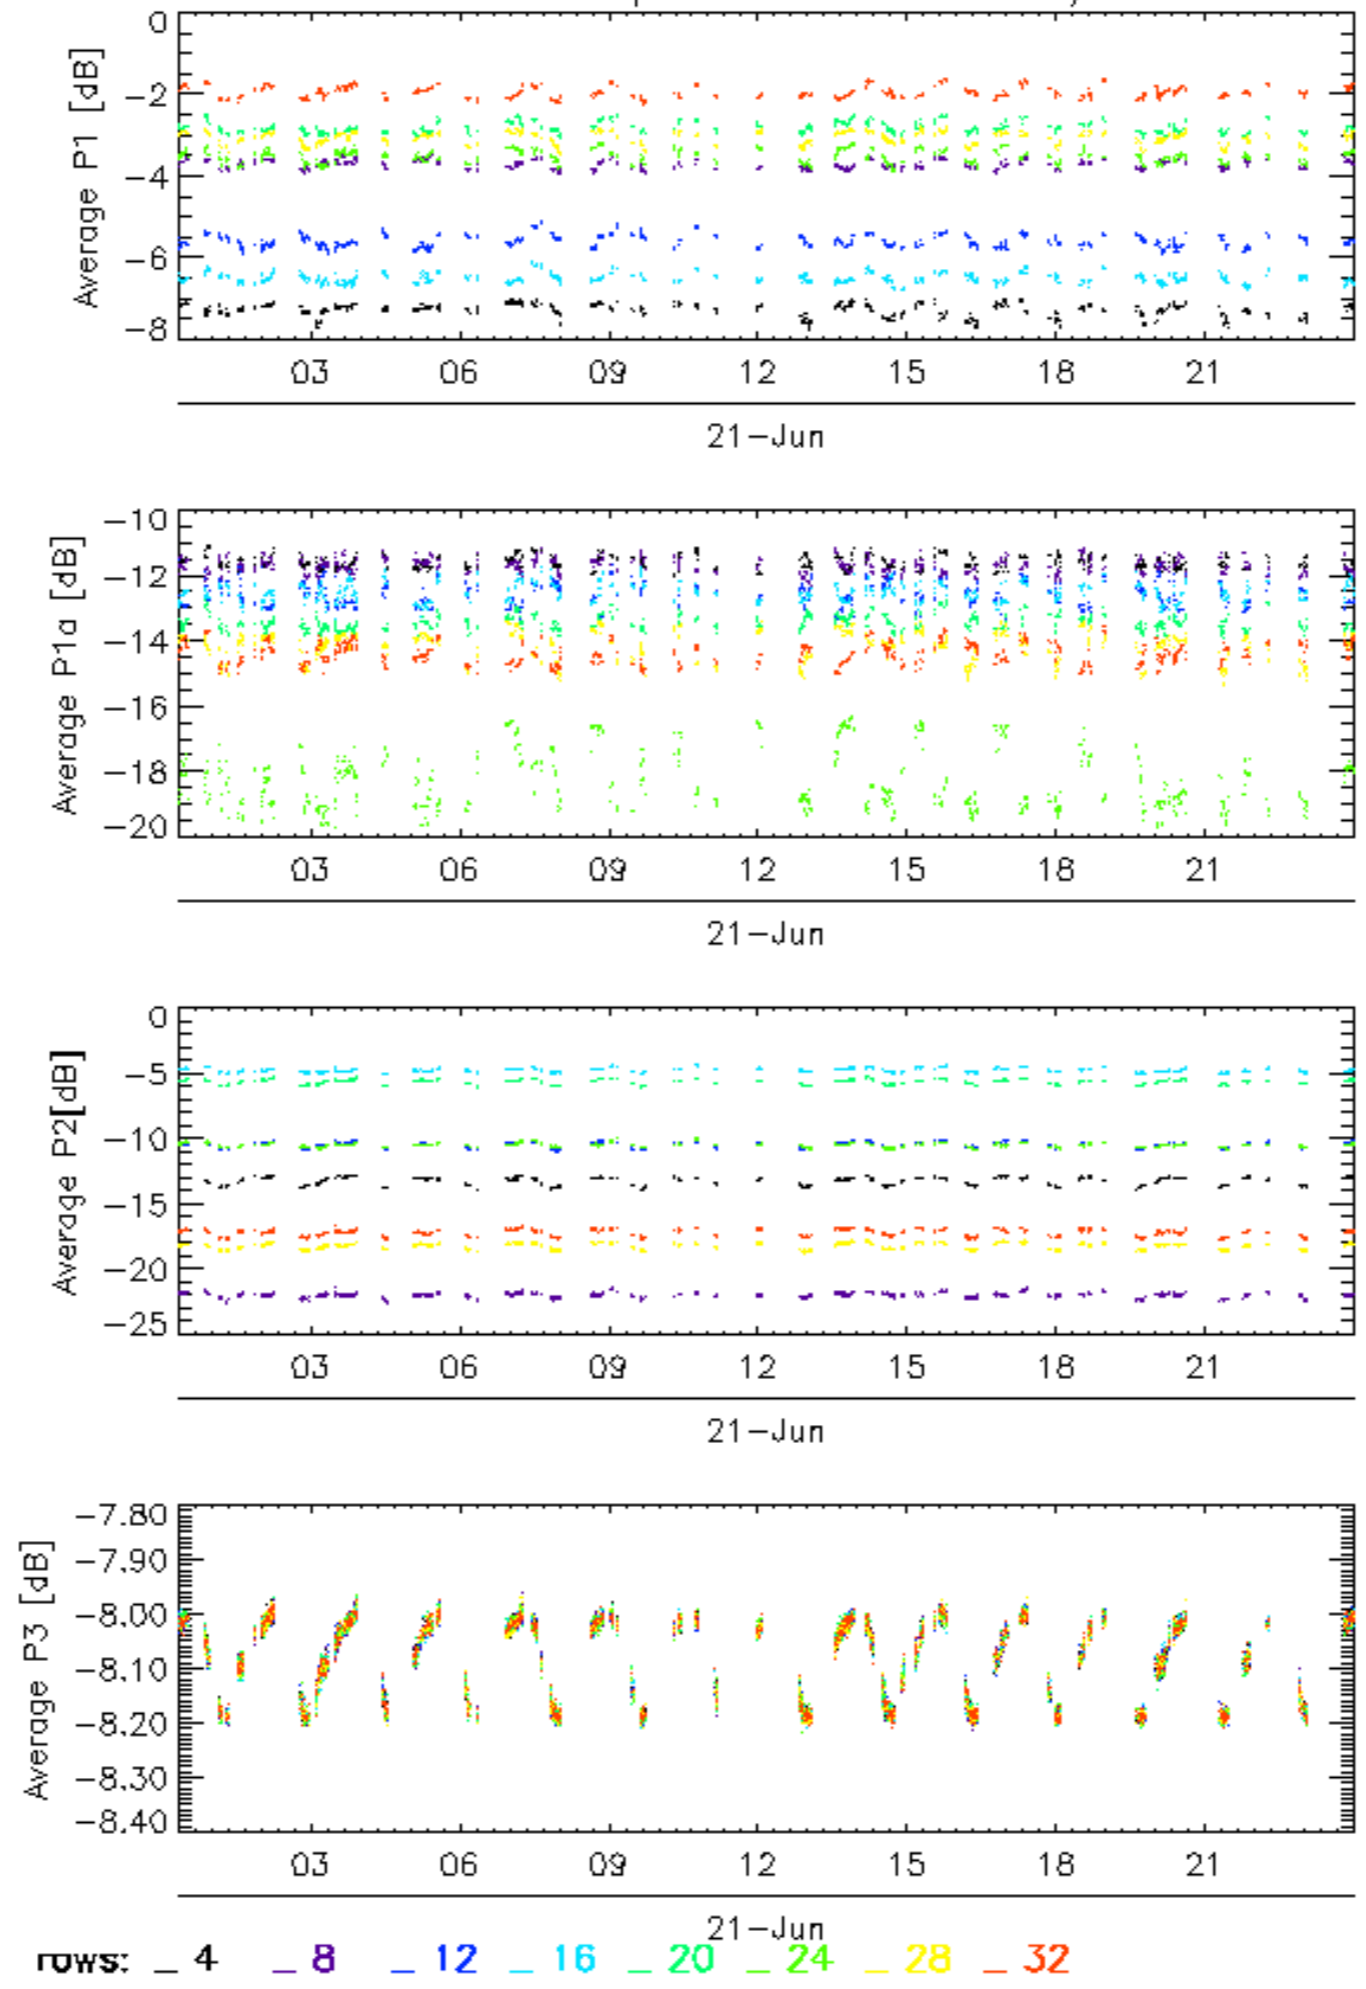


Calibration pulses for WVS IS2 V/V

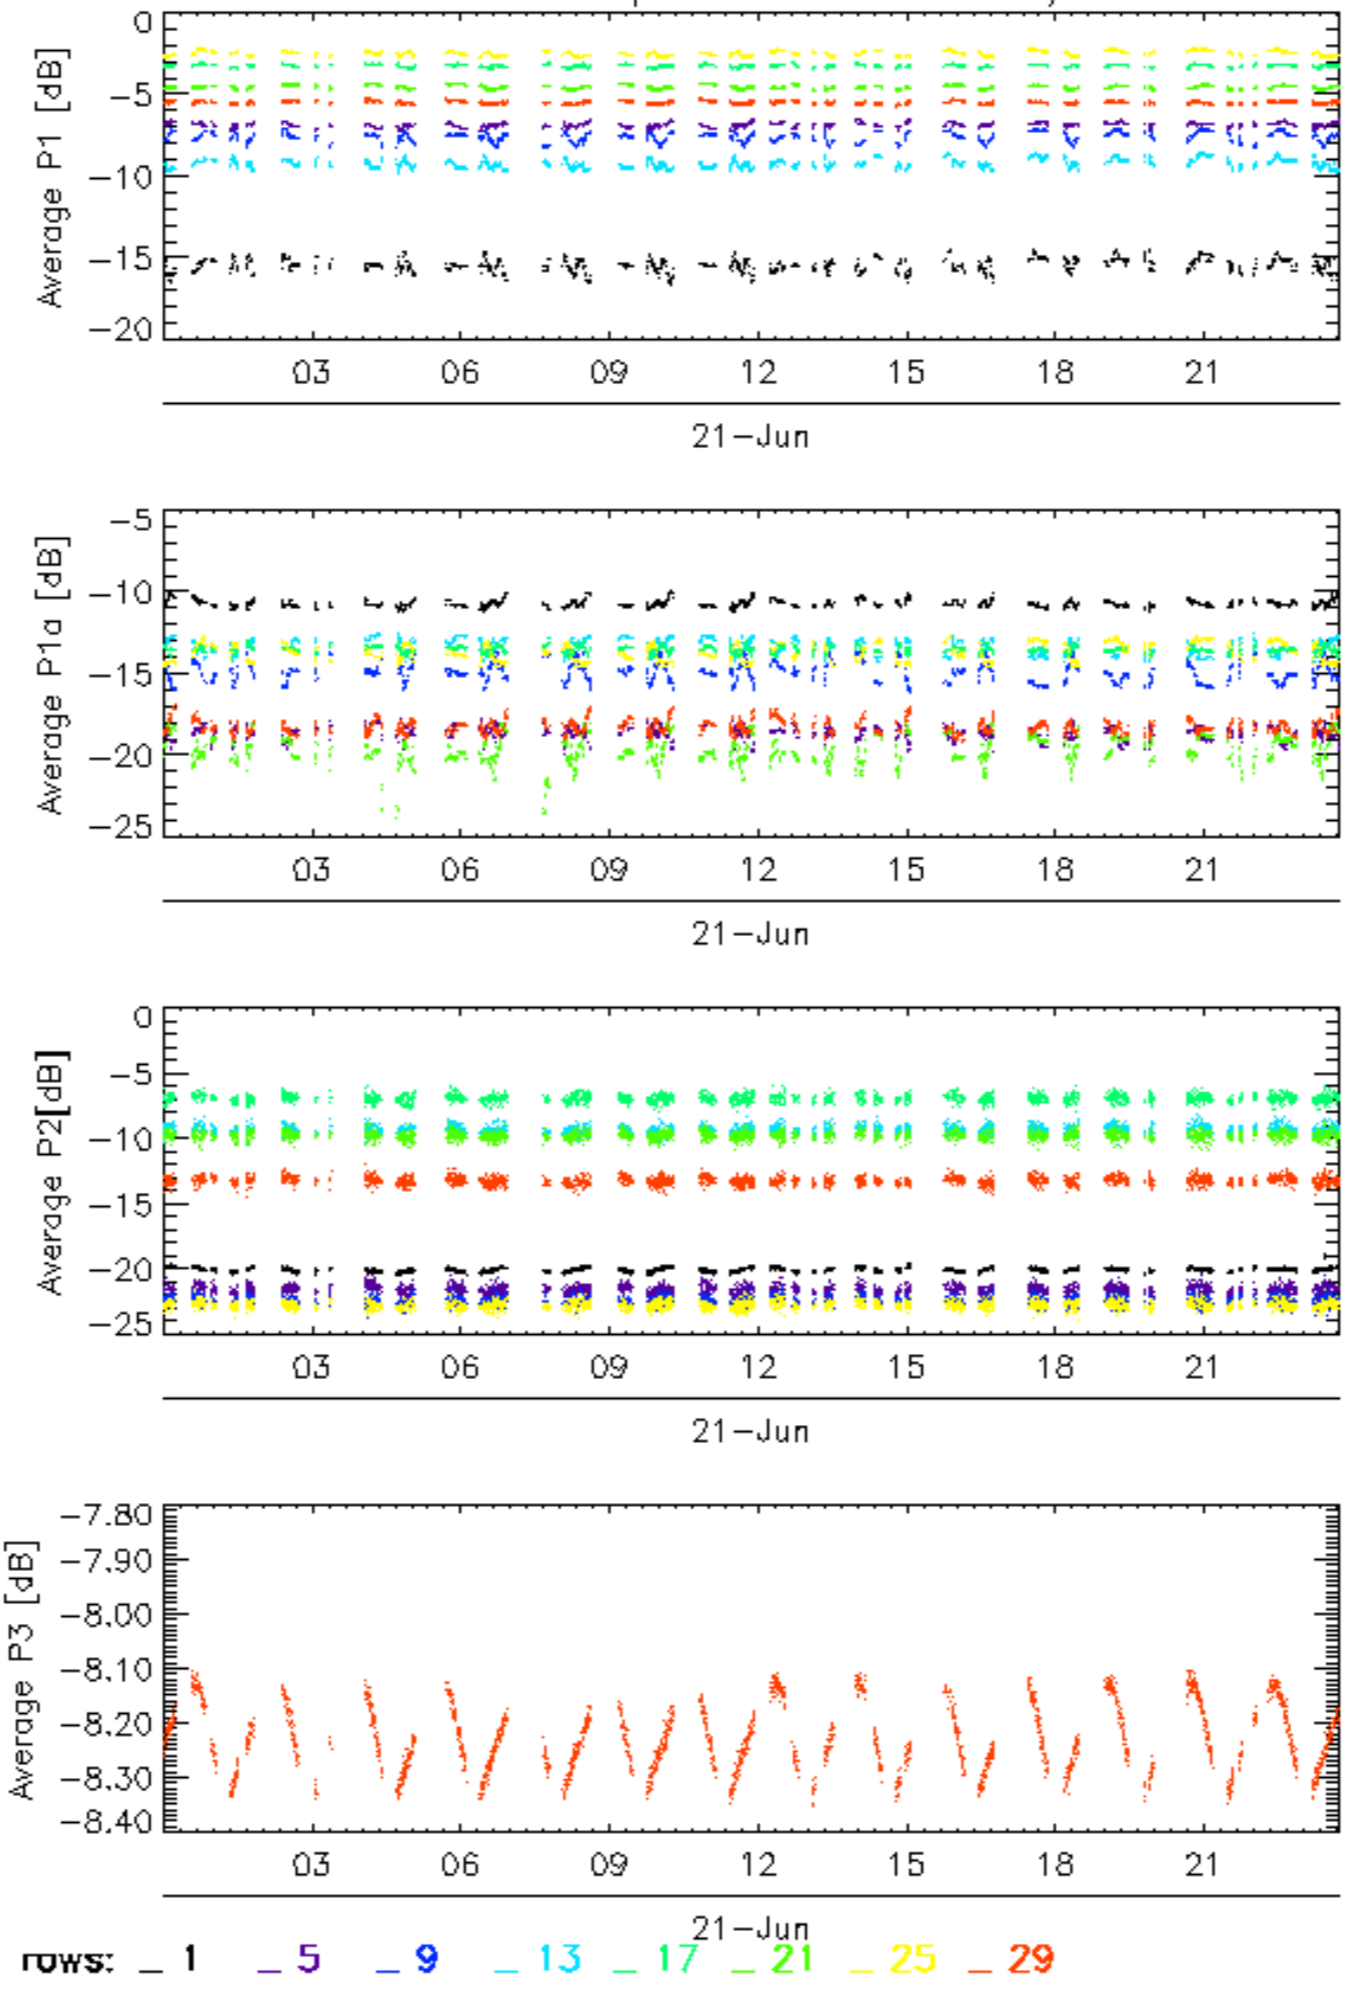


### Calibration pulses for WVS IS2 V/V

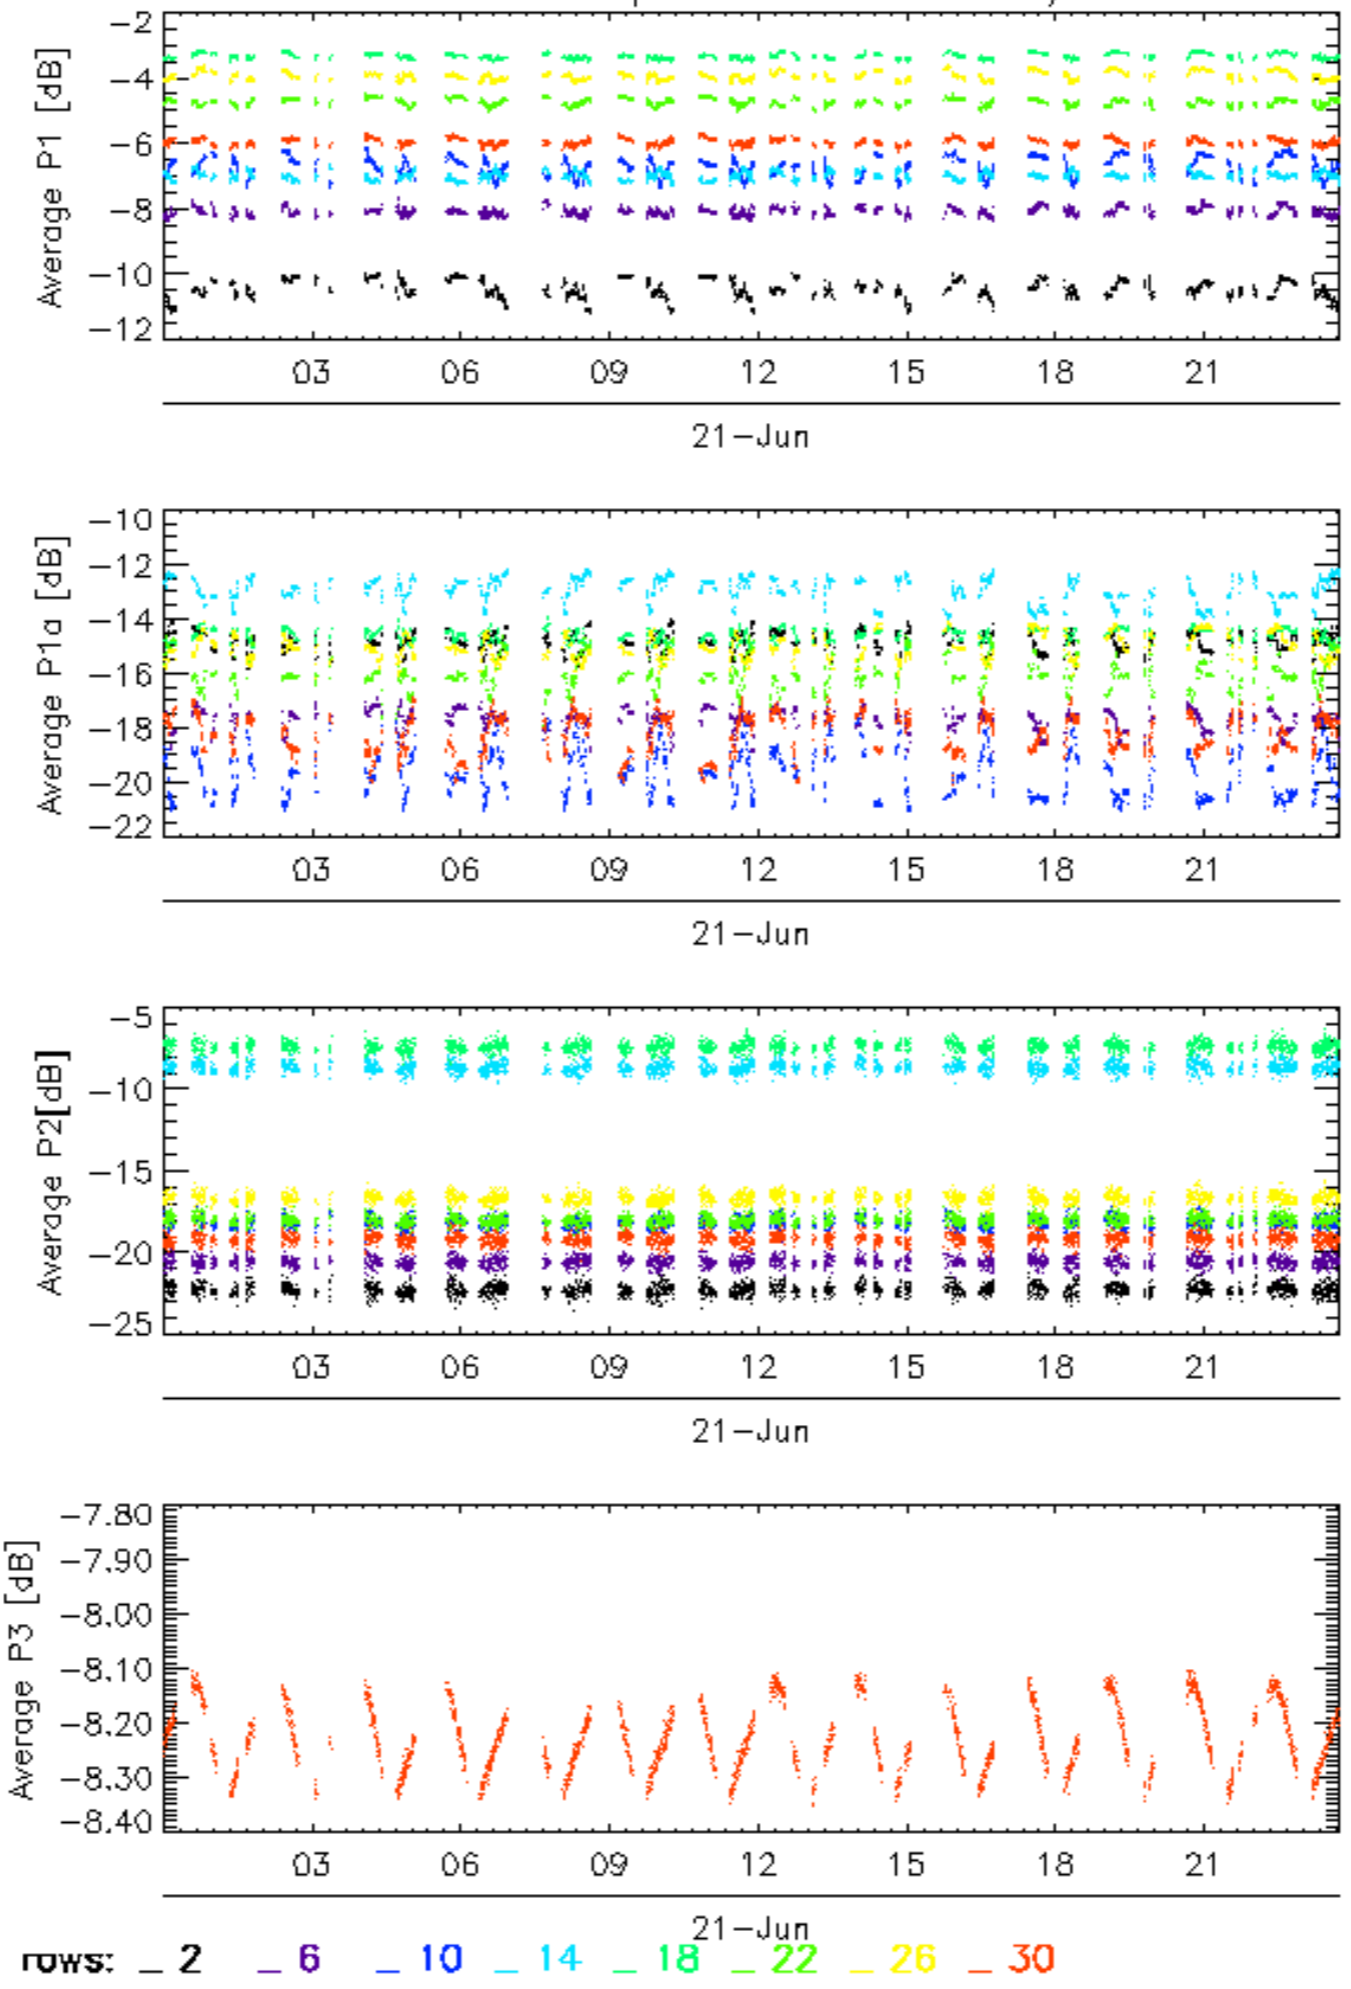



Calibration pulses for WVS IS2 V/V


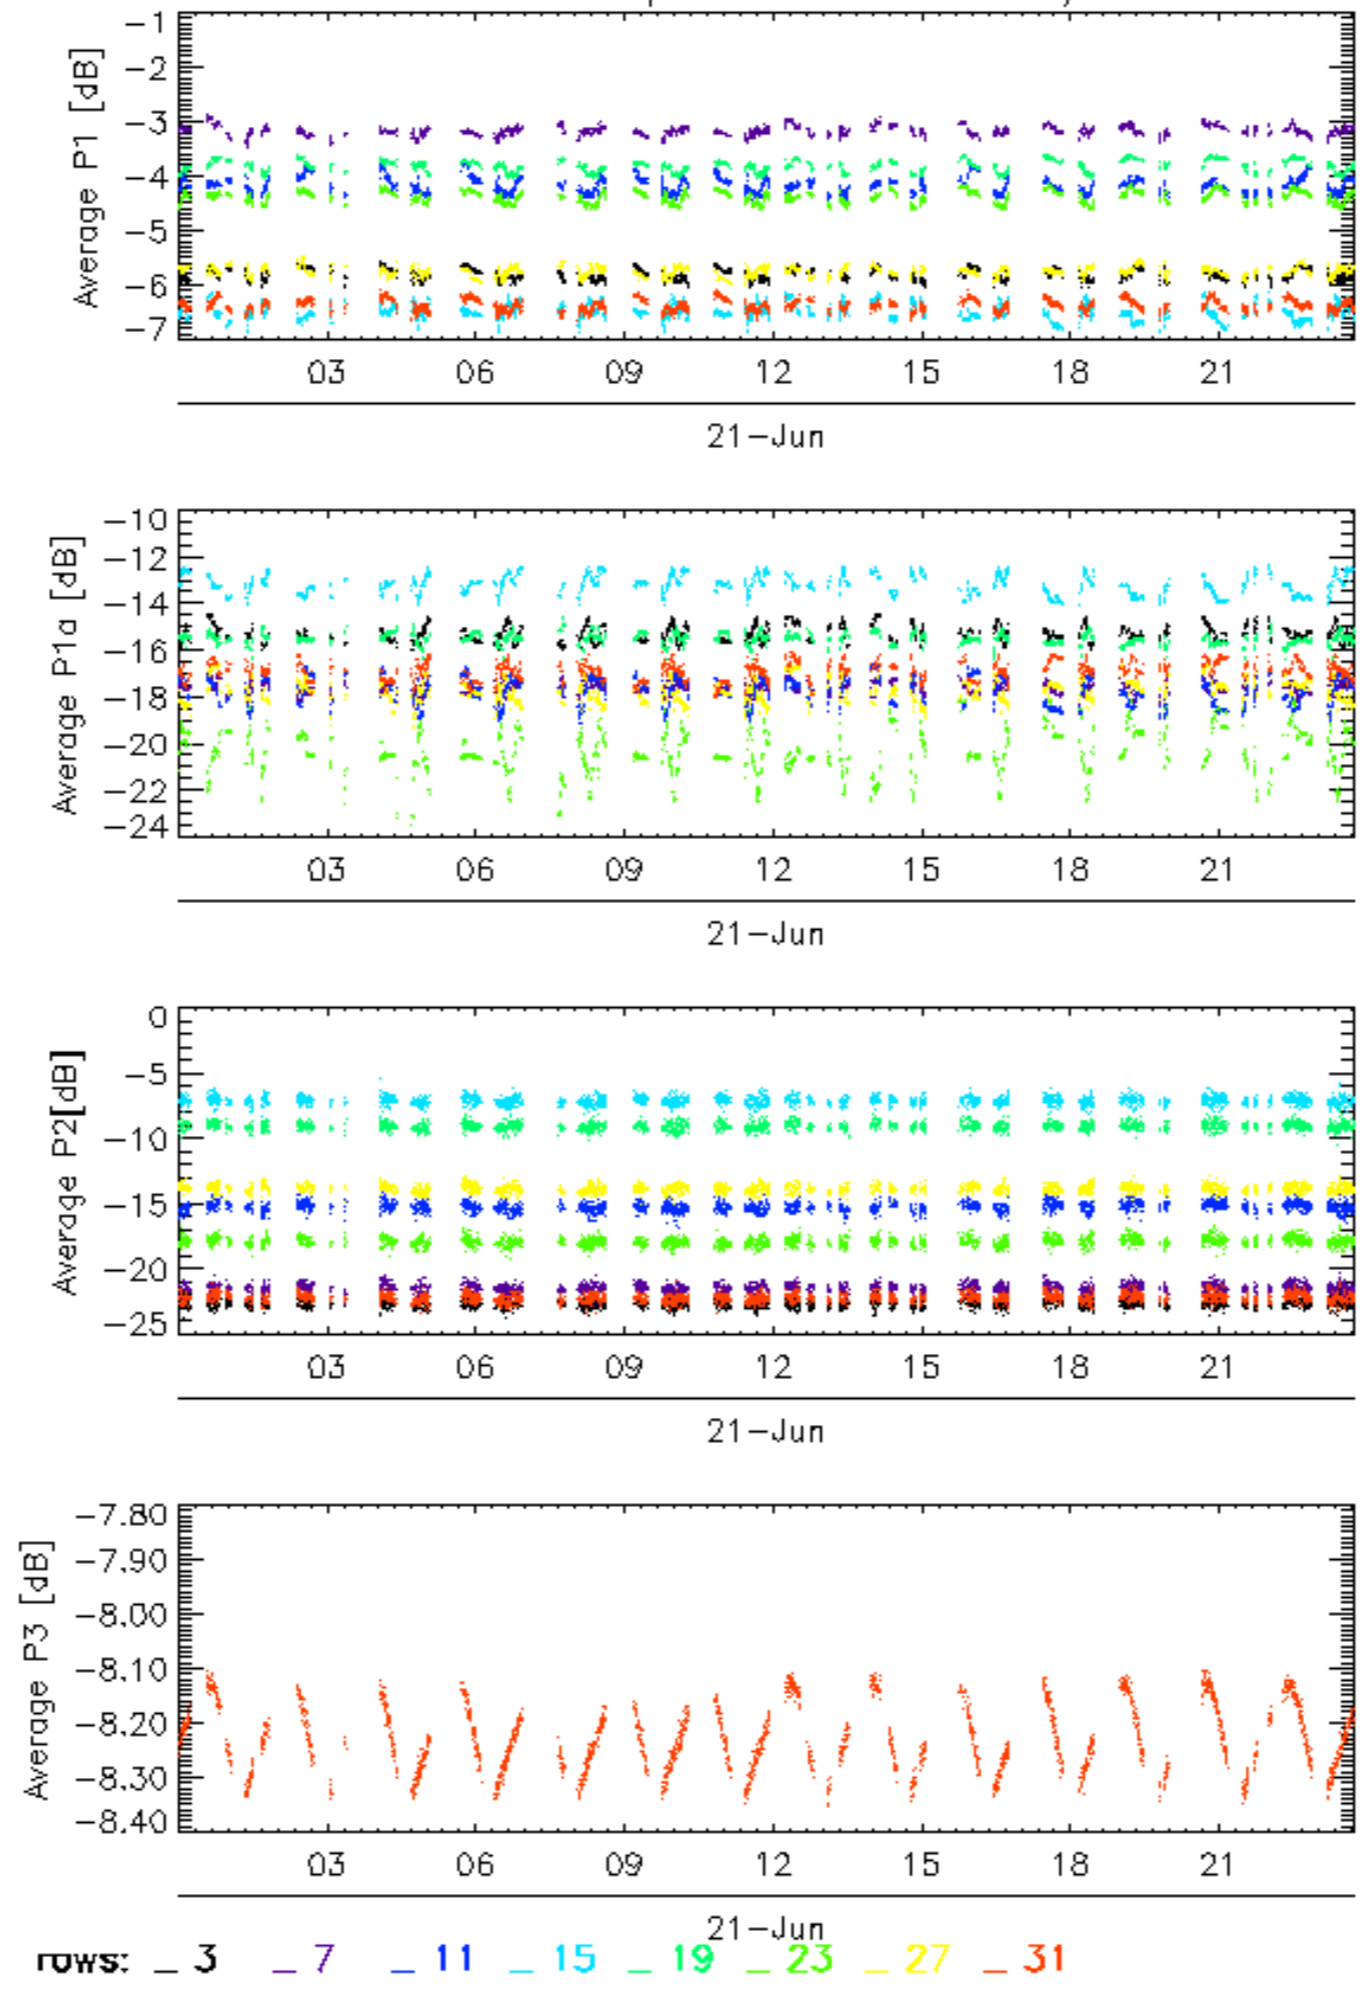


### Calibration pulses for WVS IS2 V/V


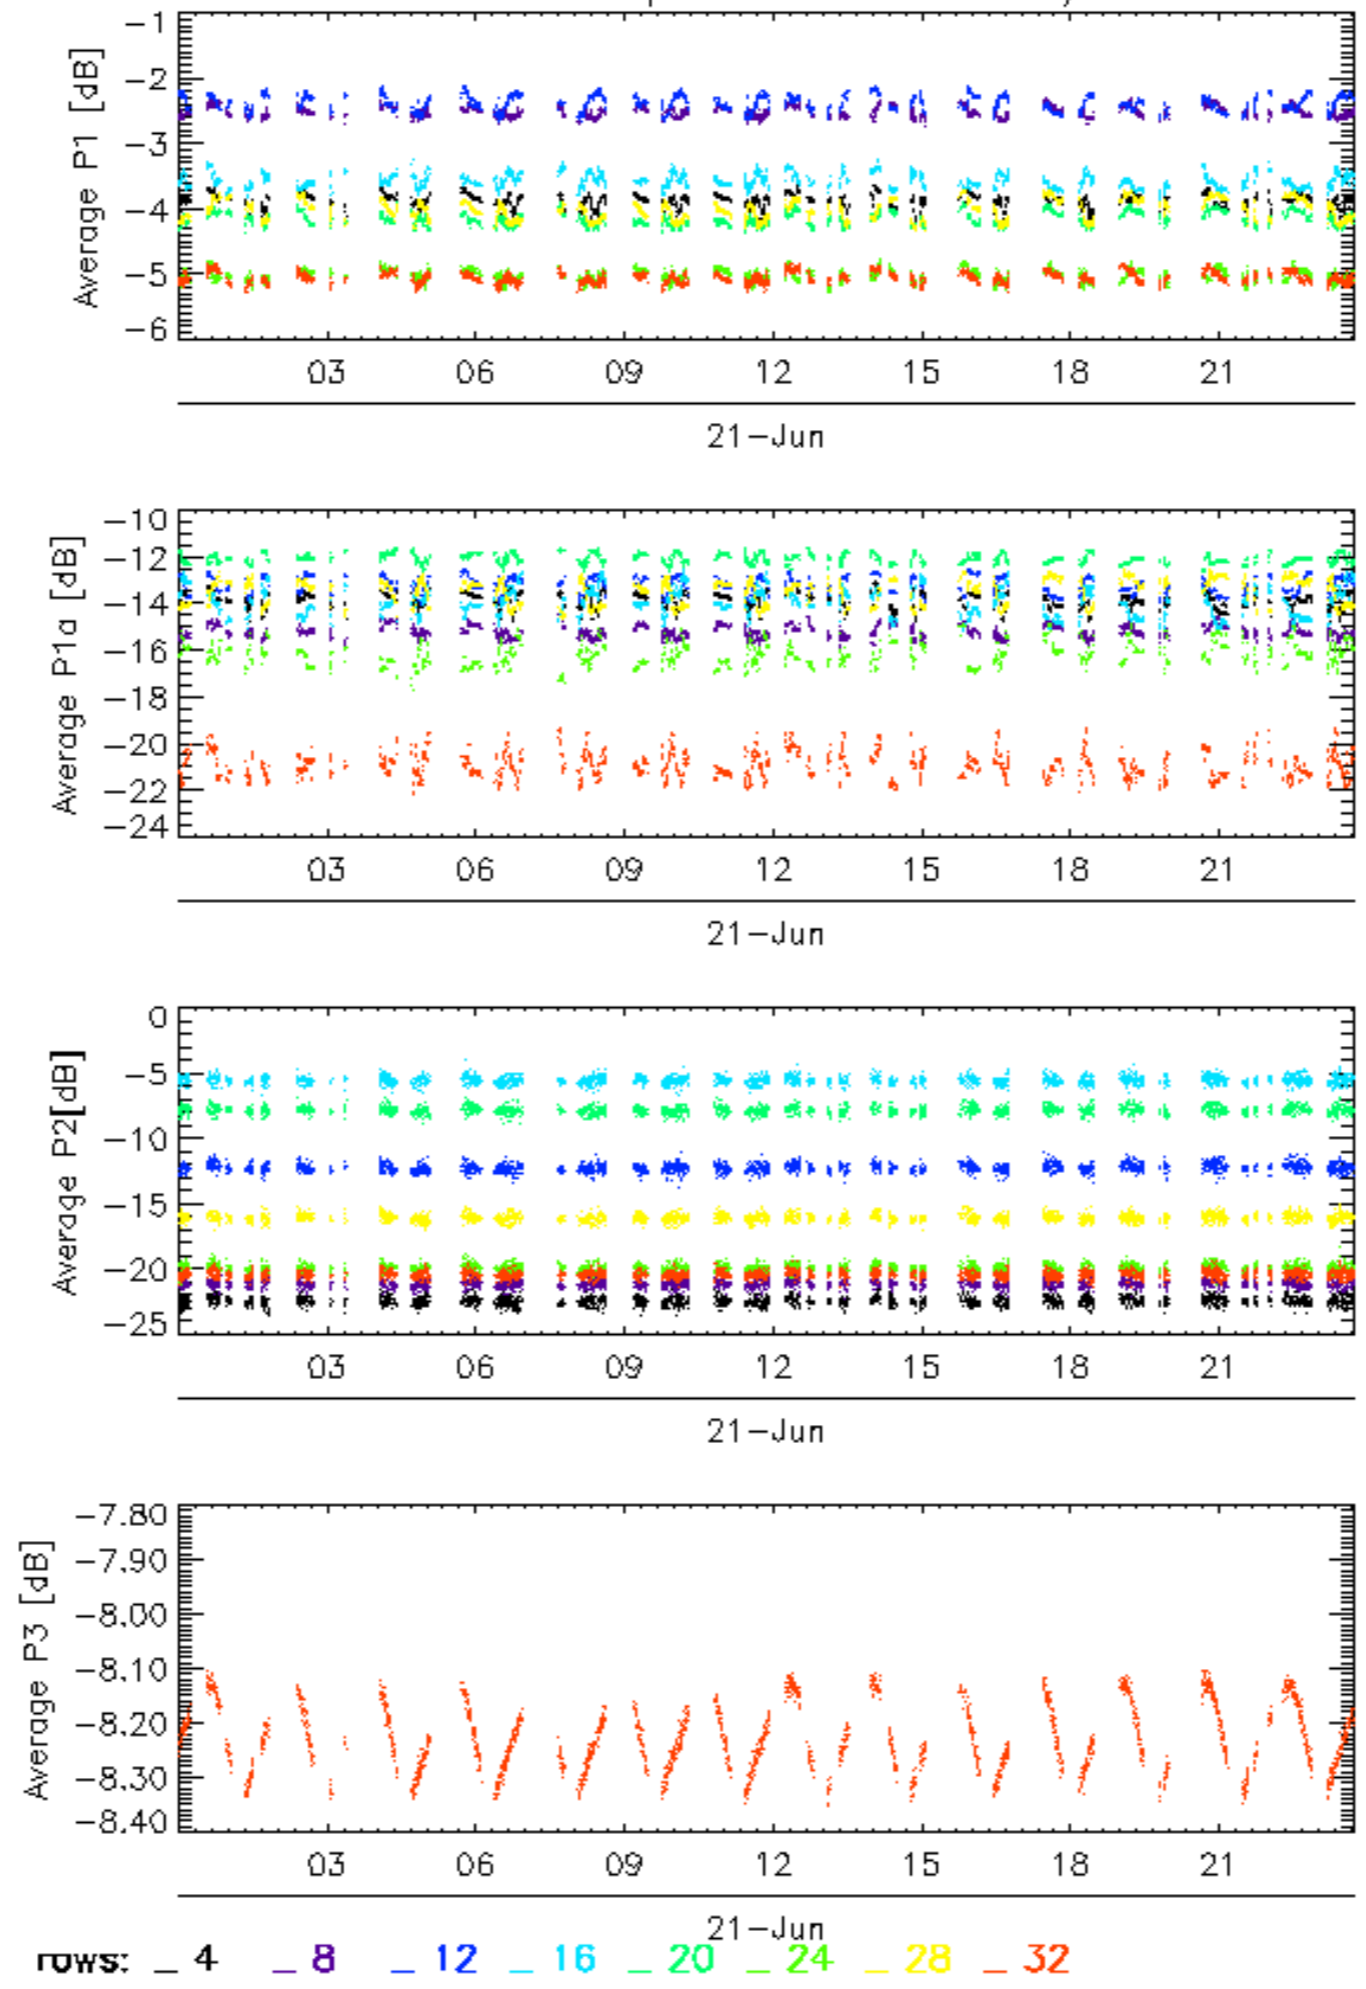



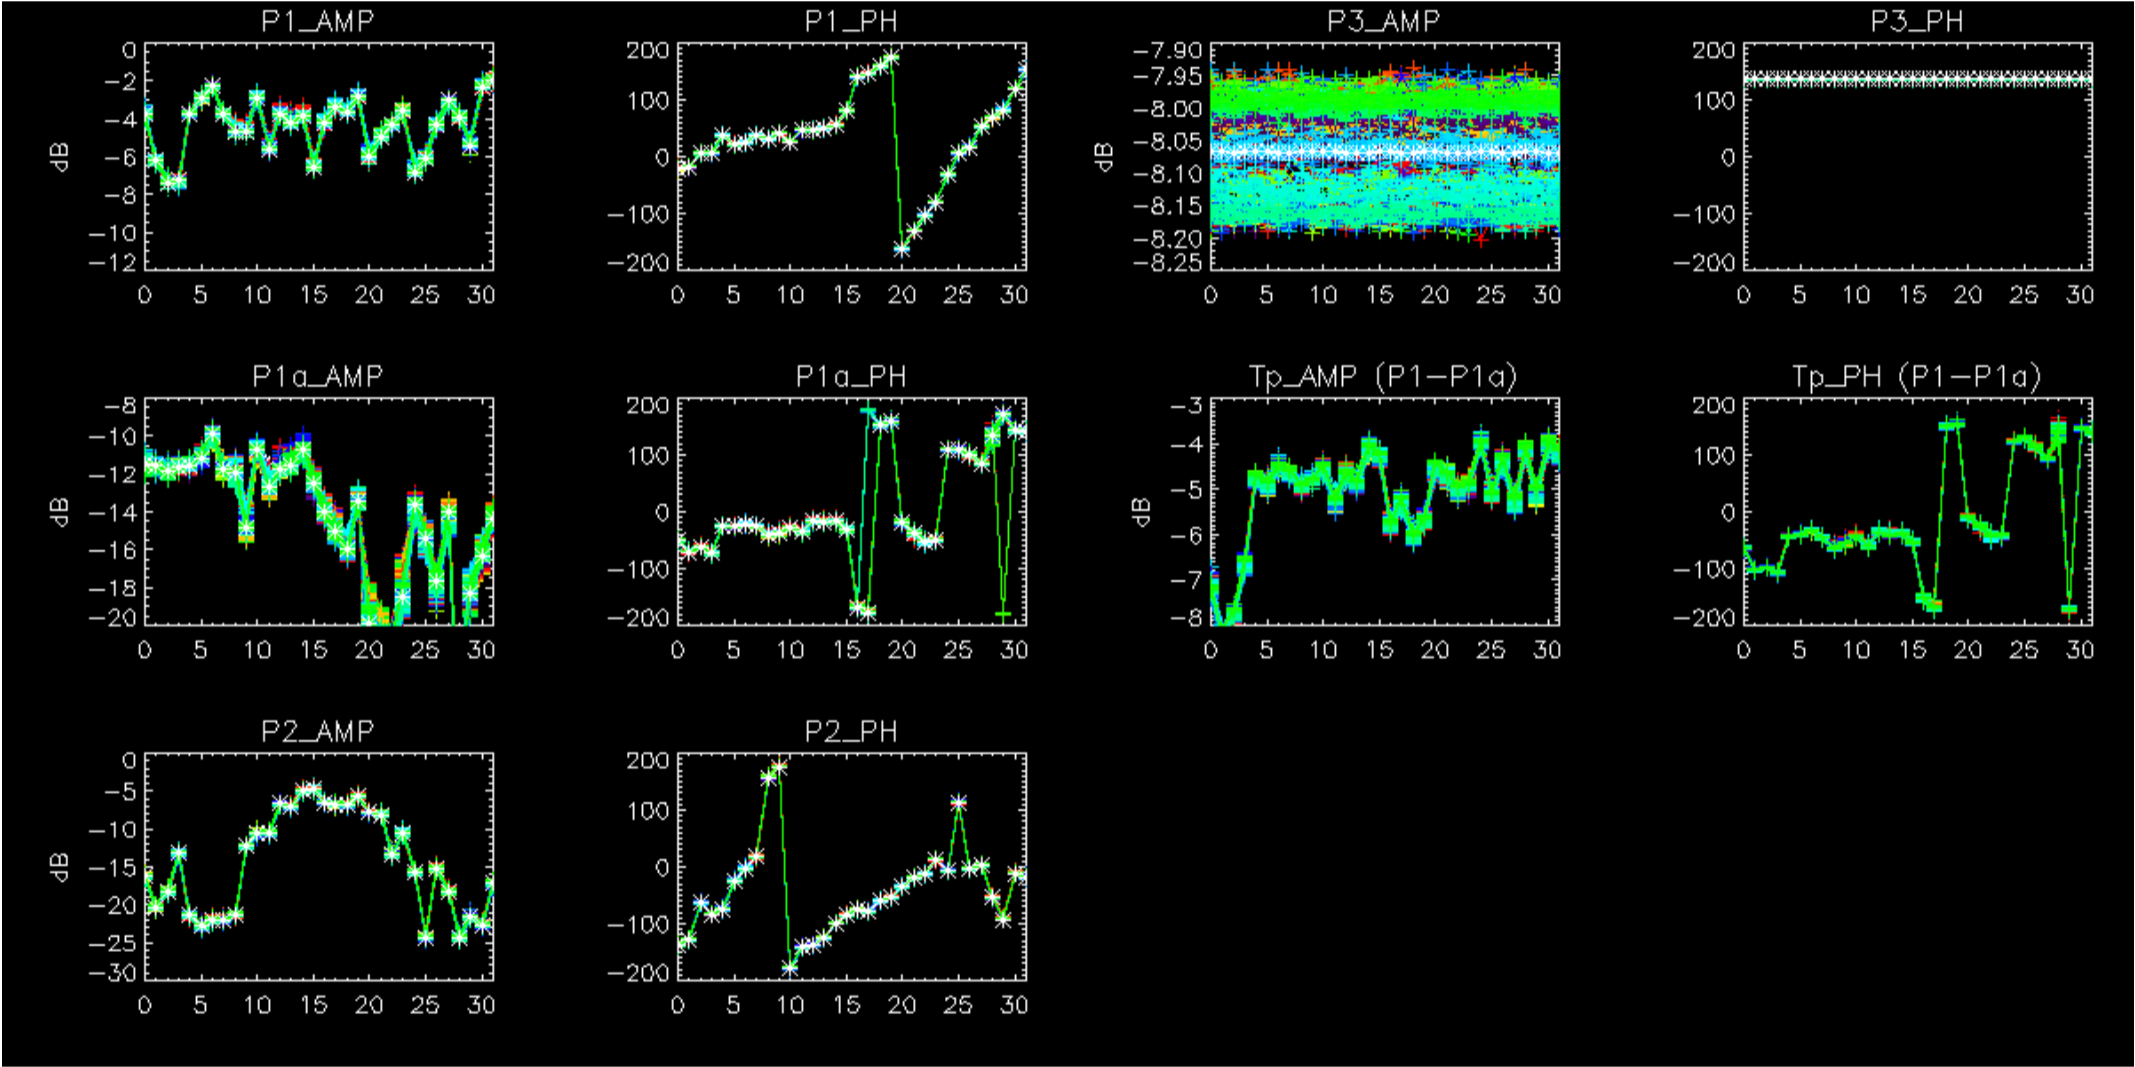



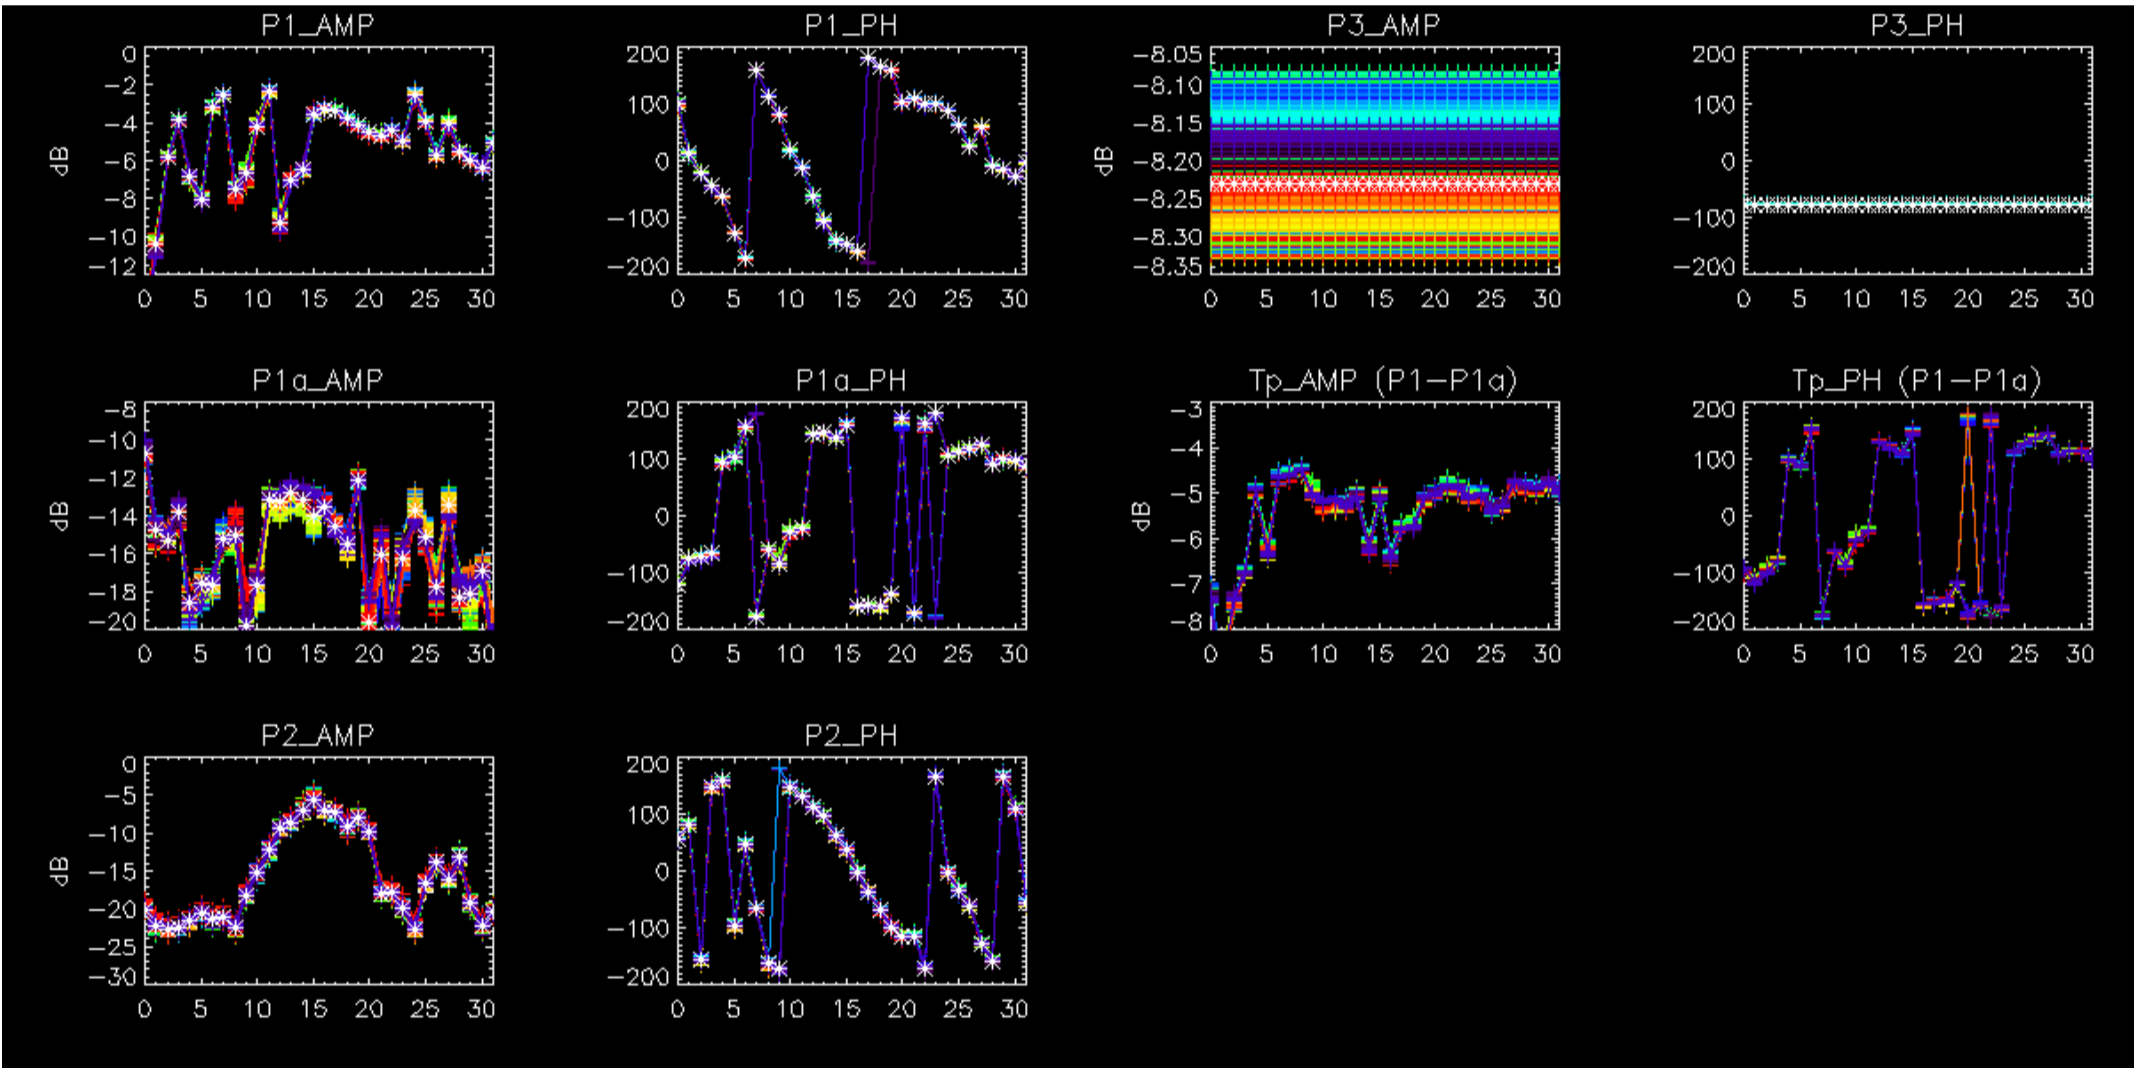


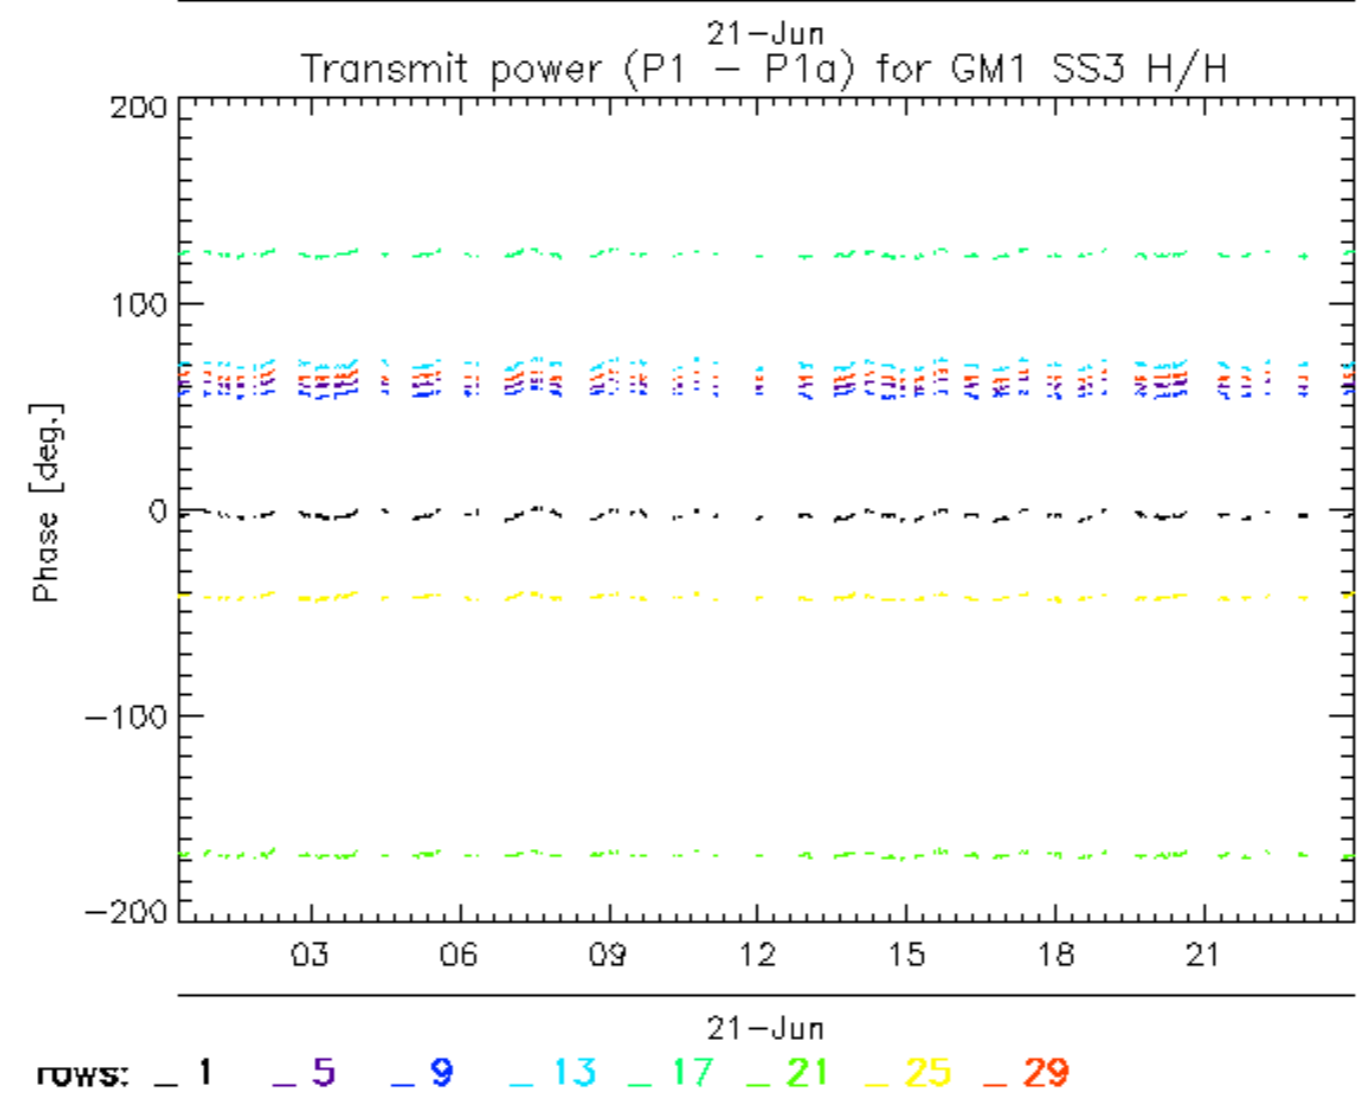
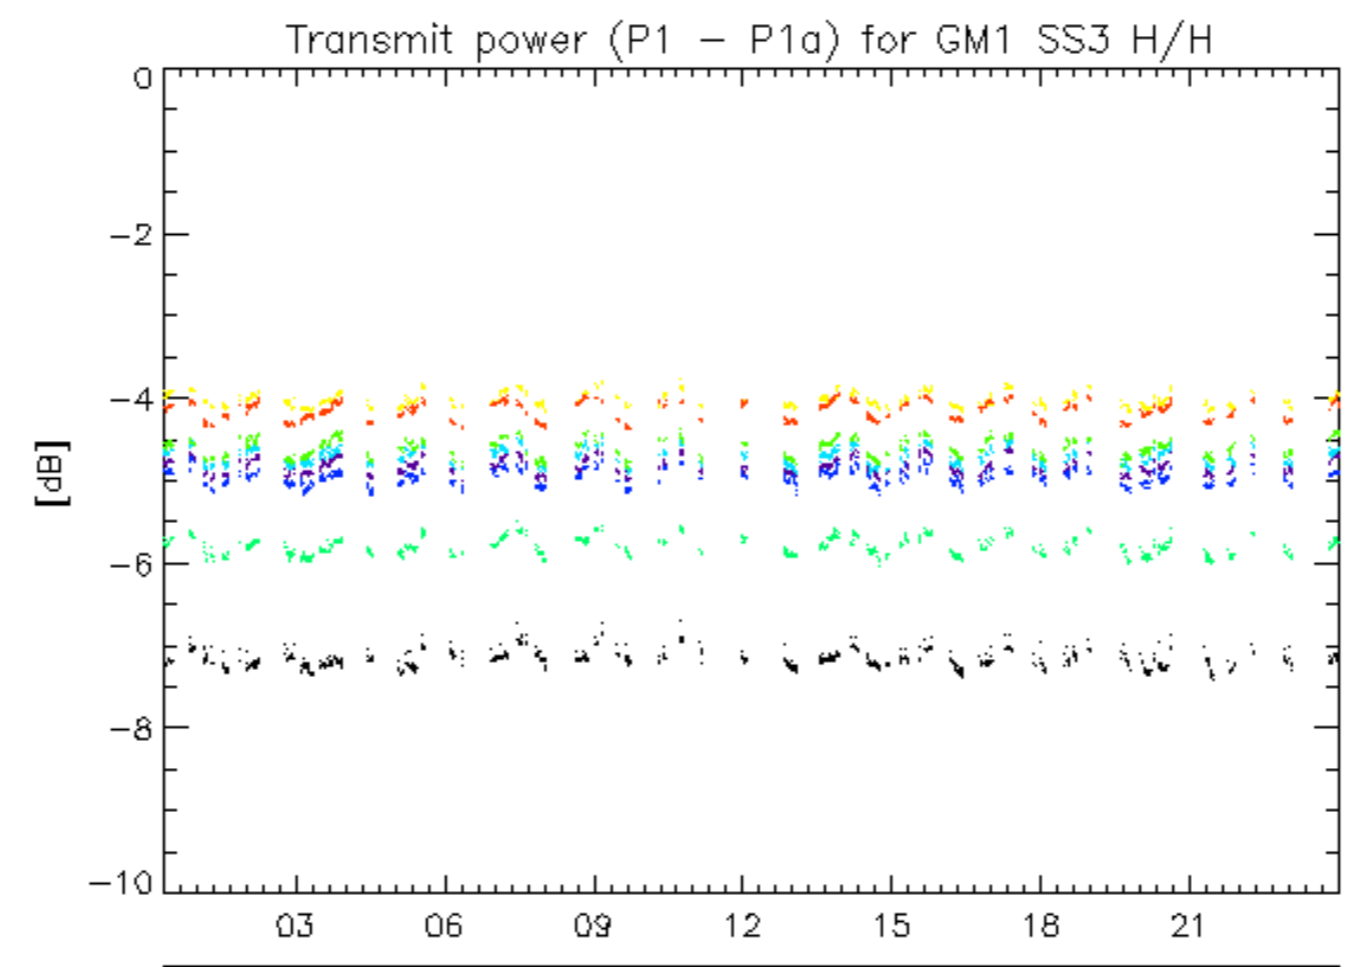






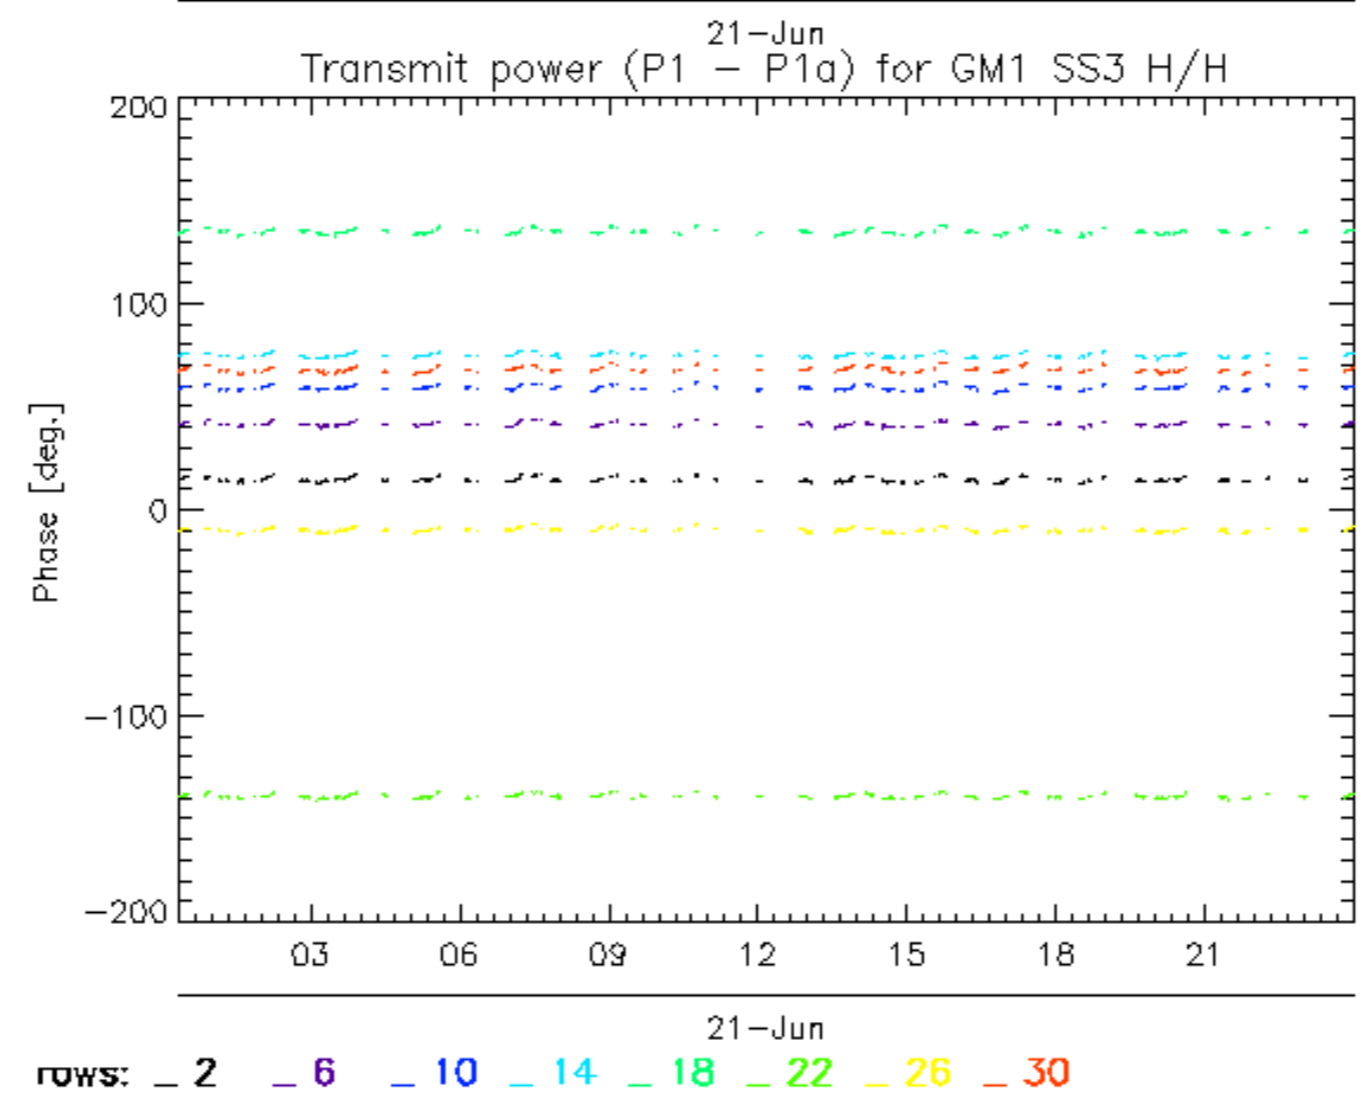
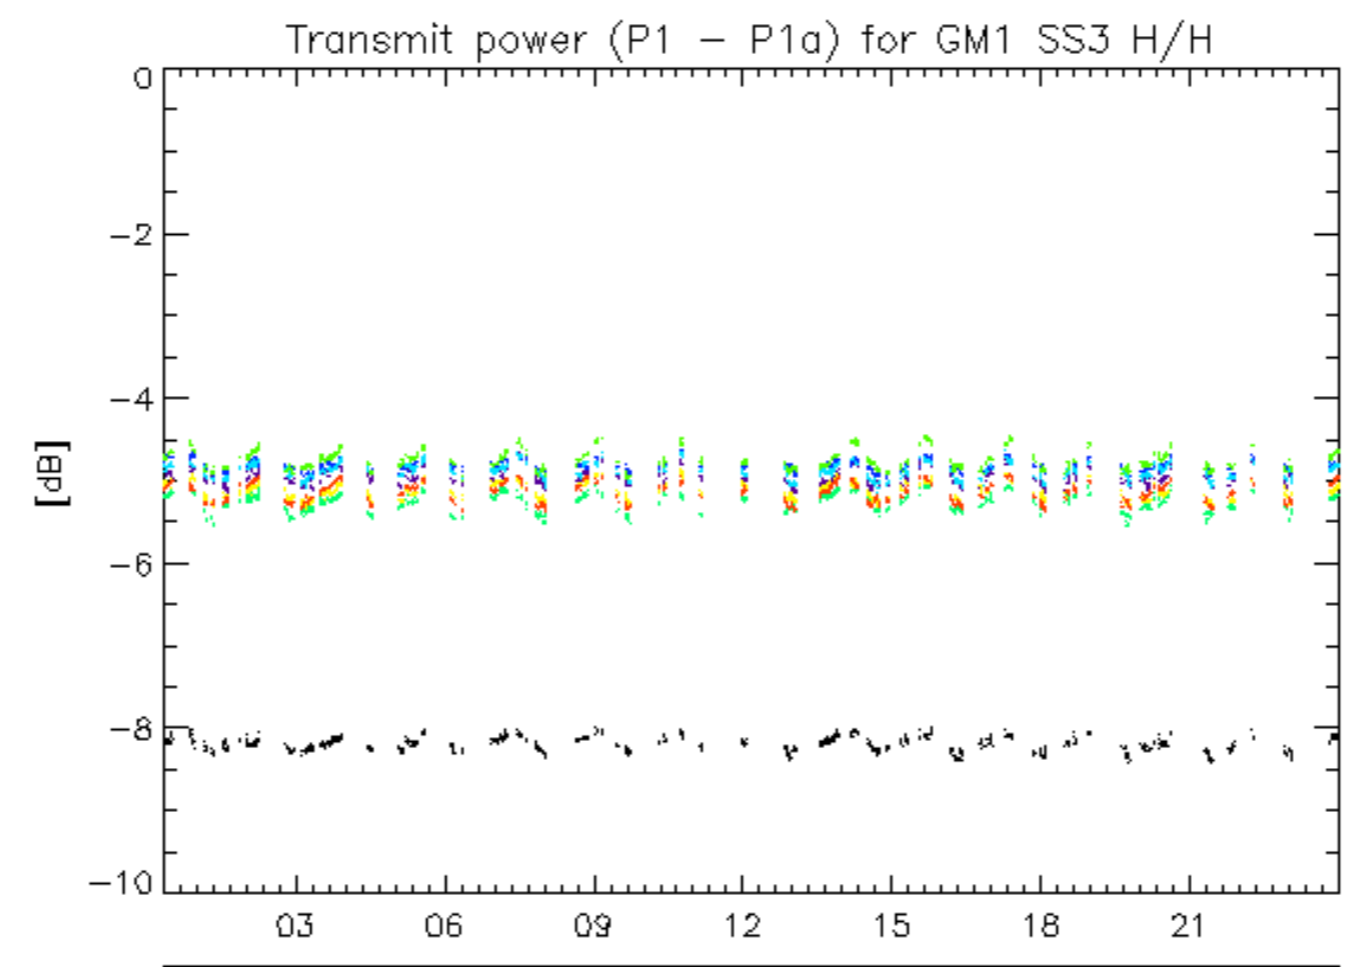


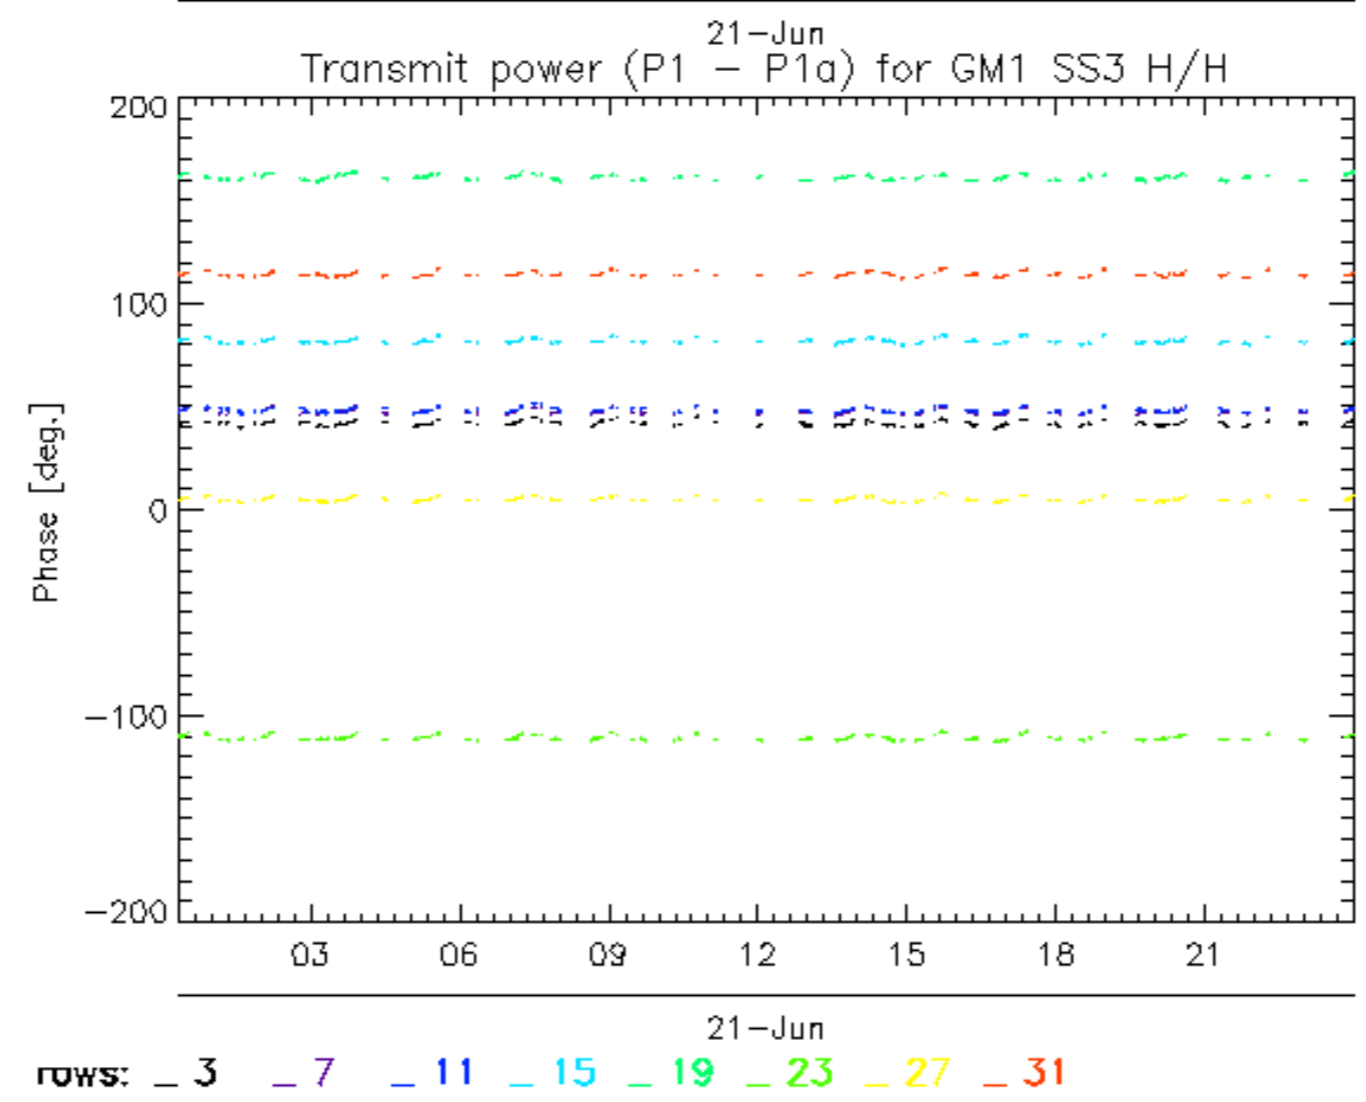
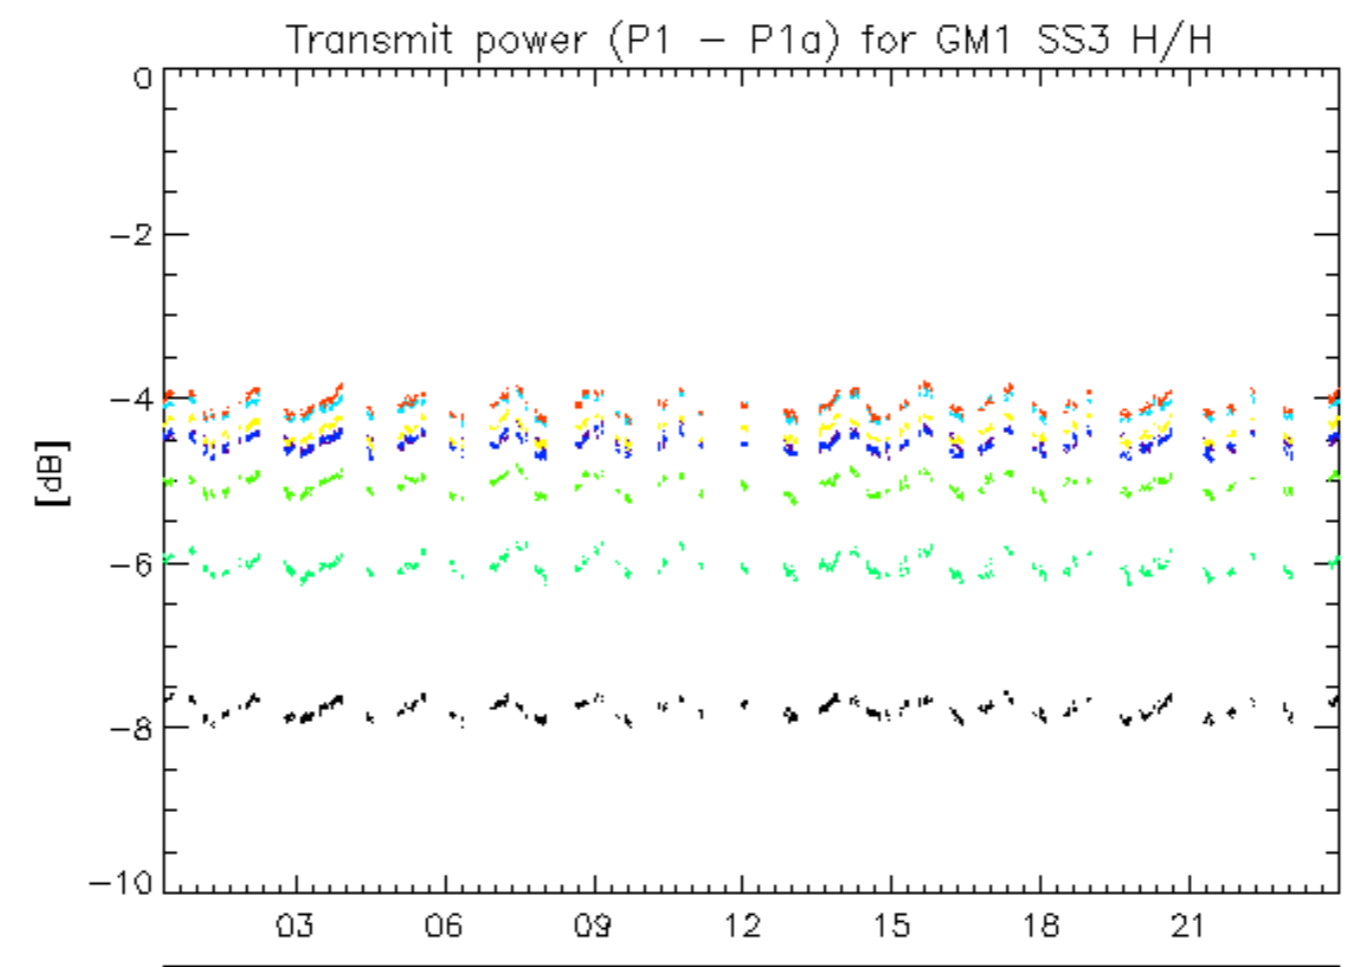


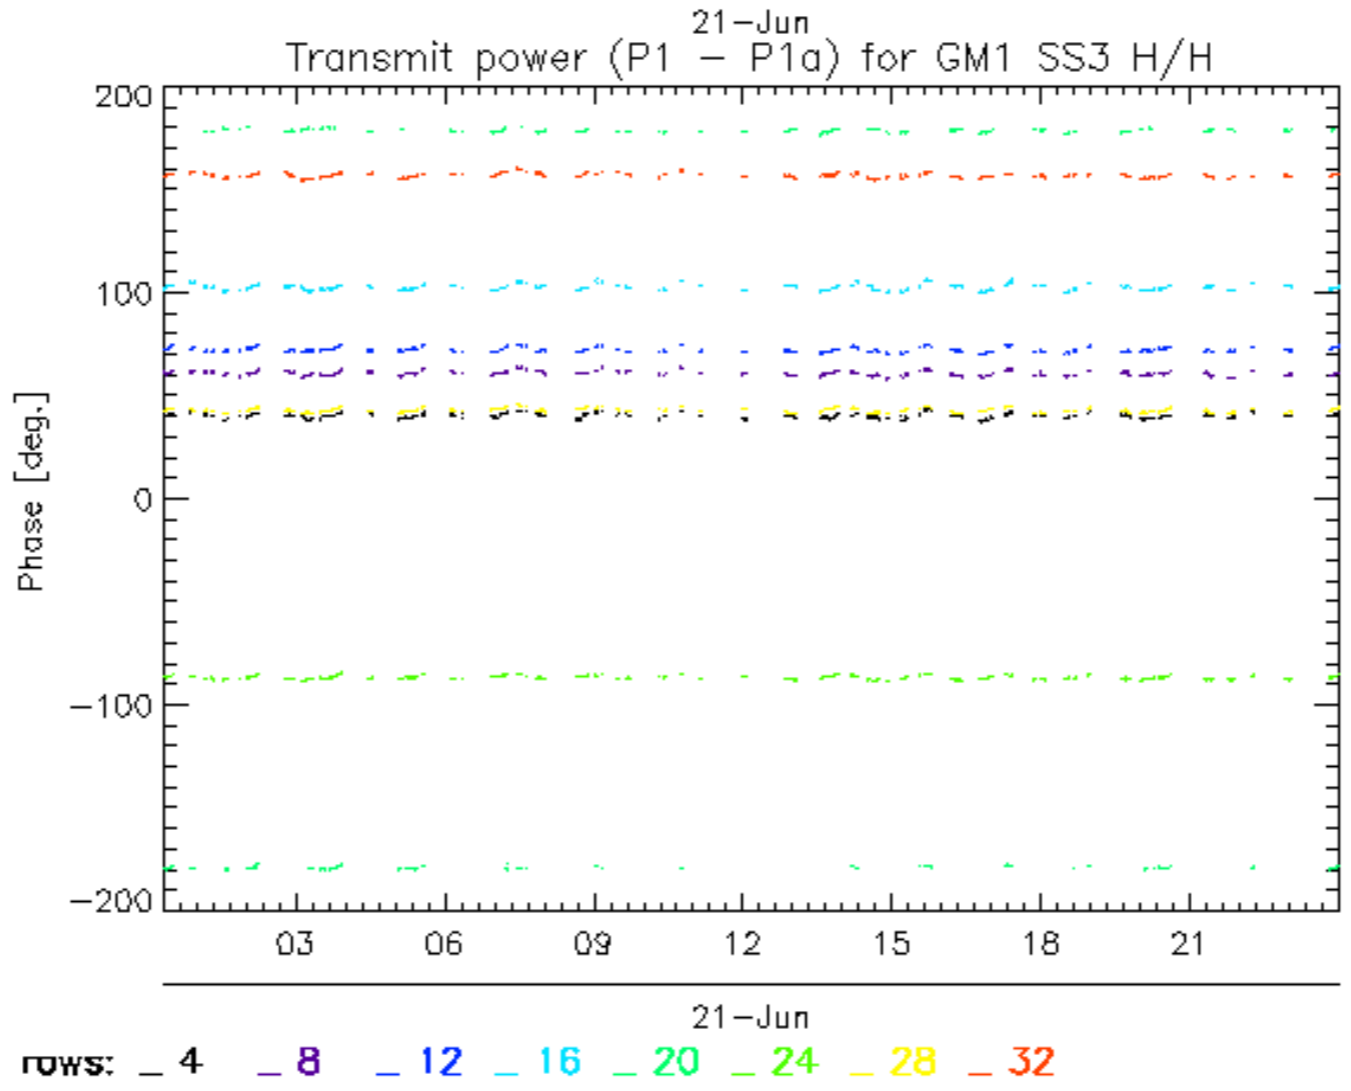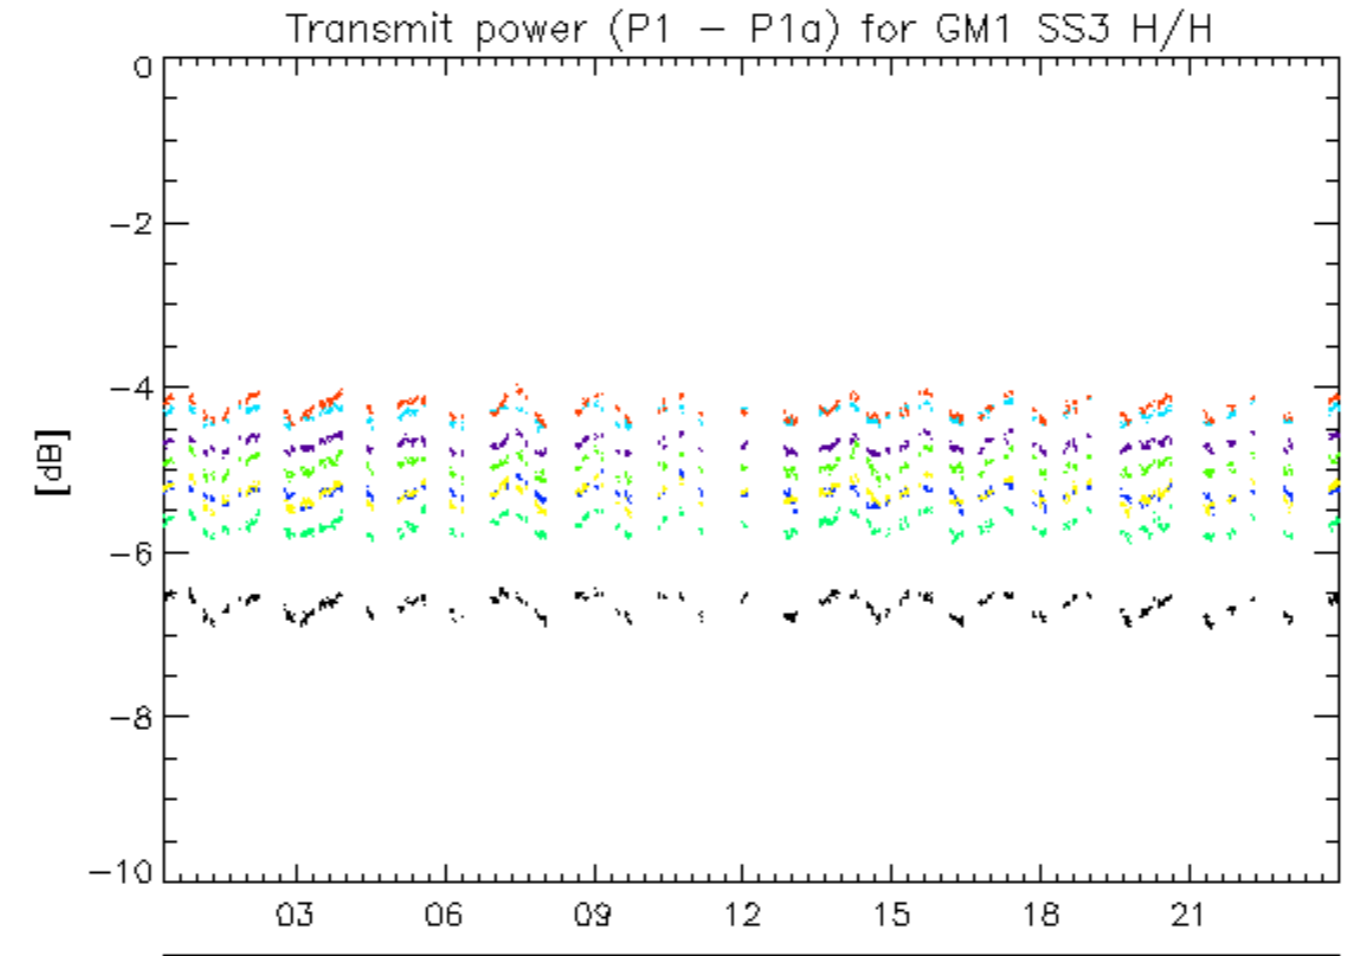


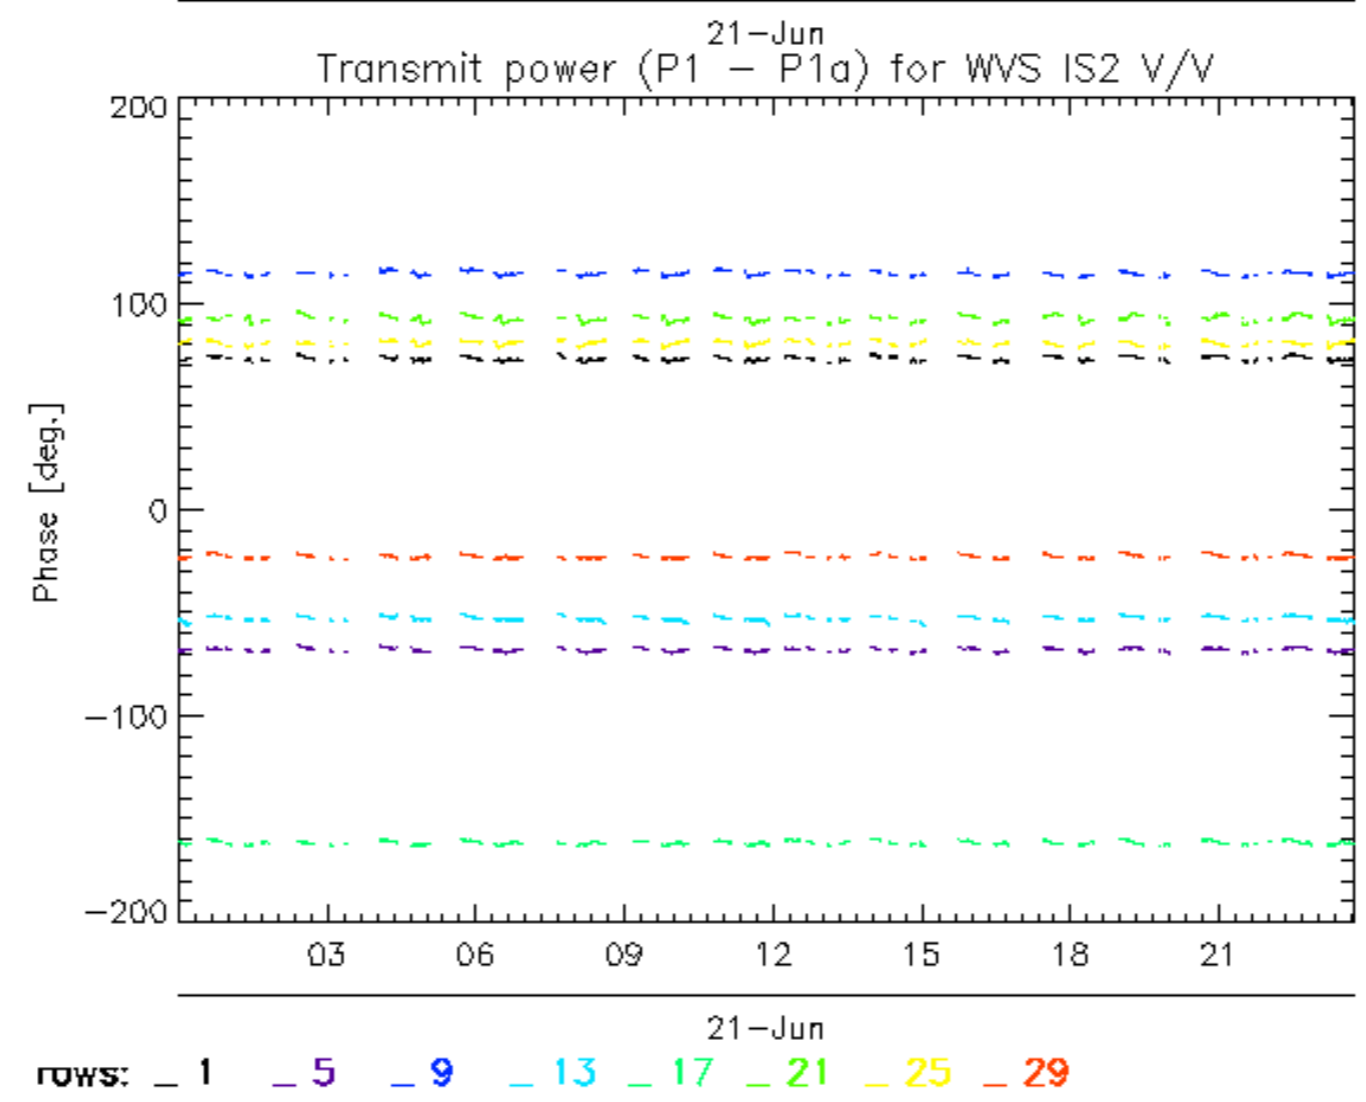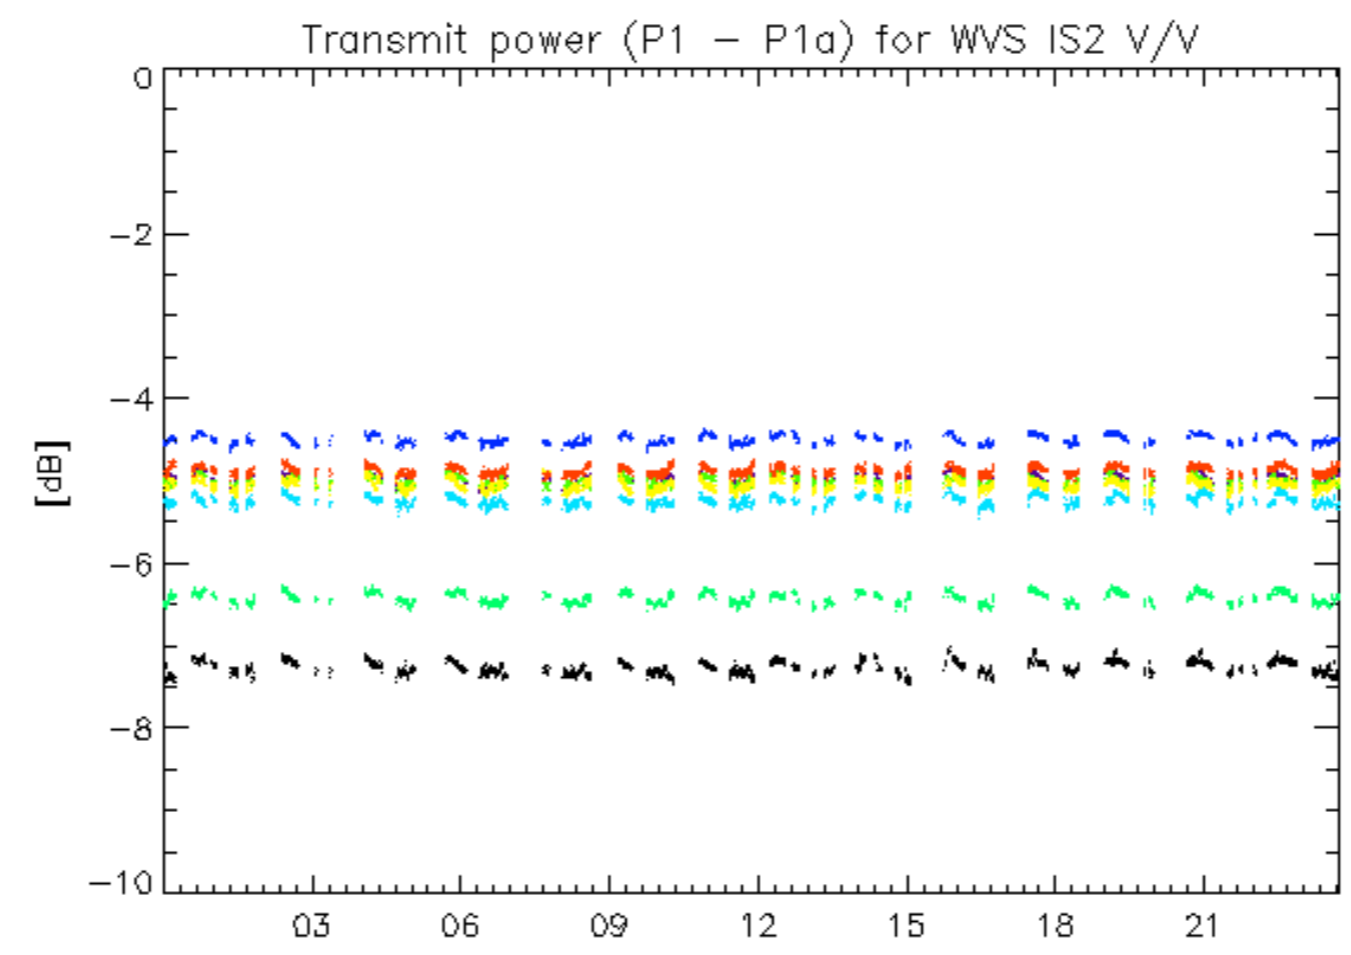

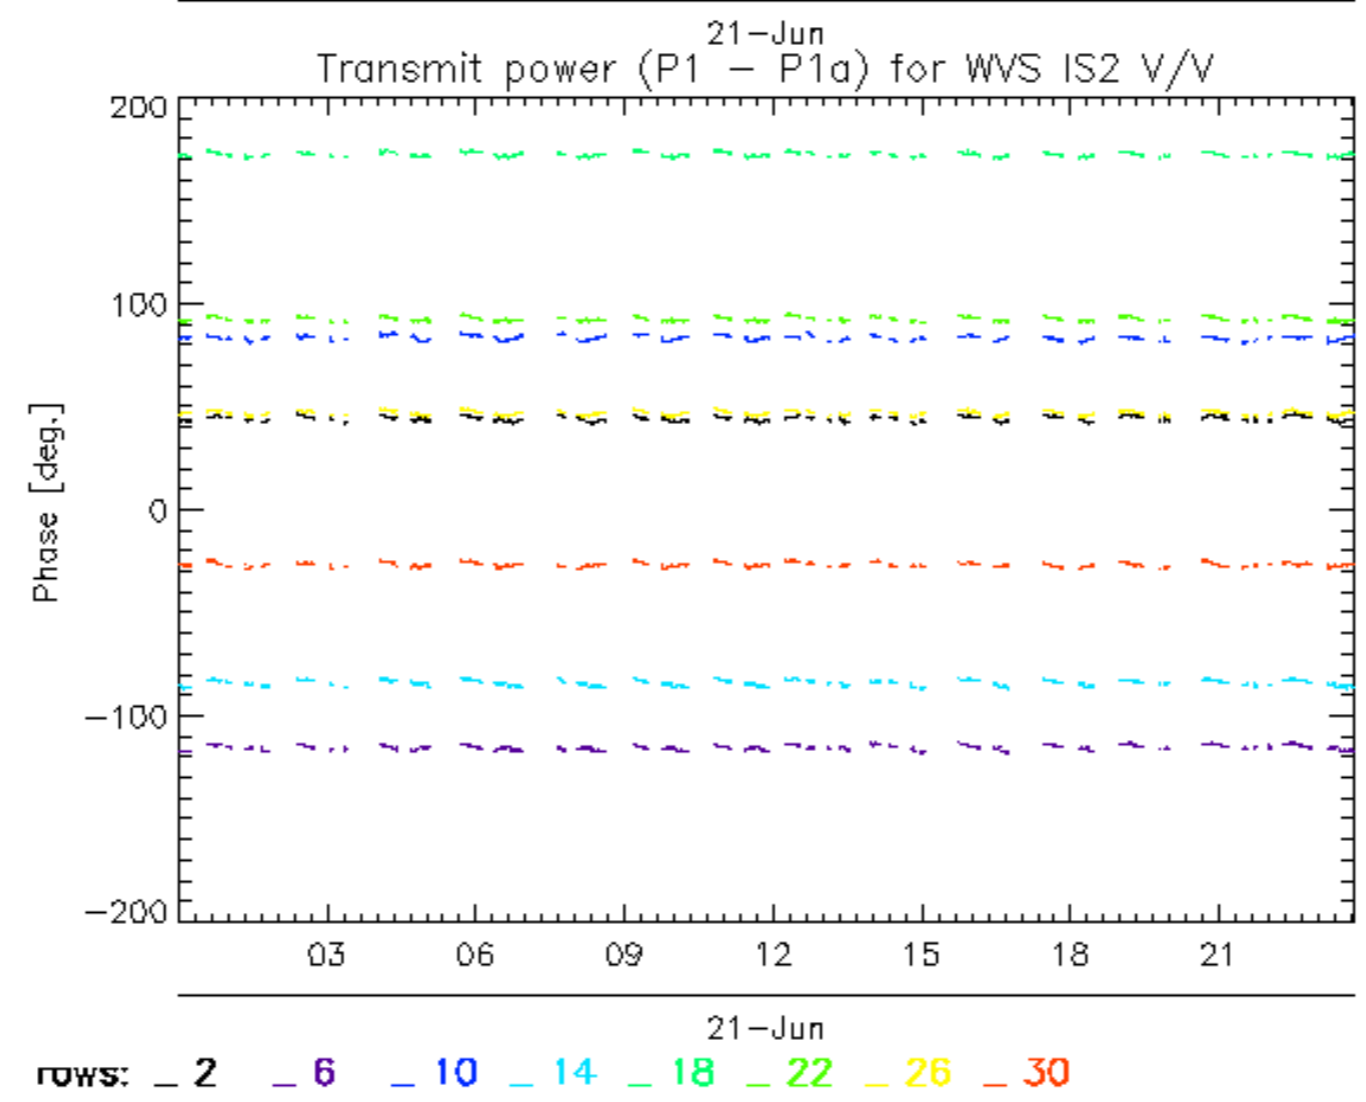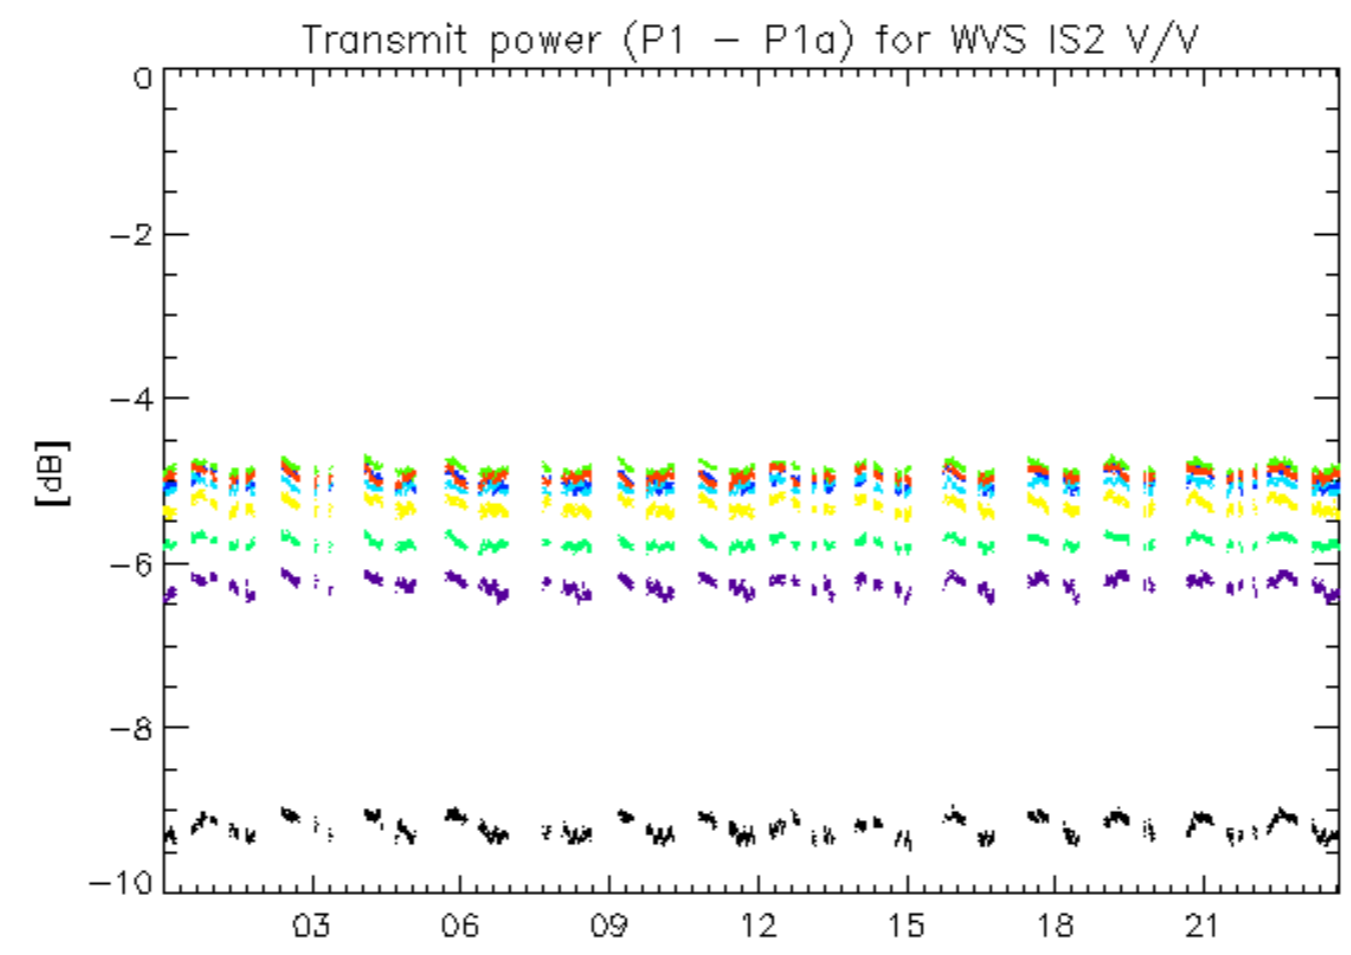


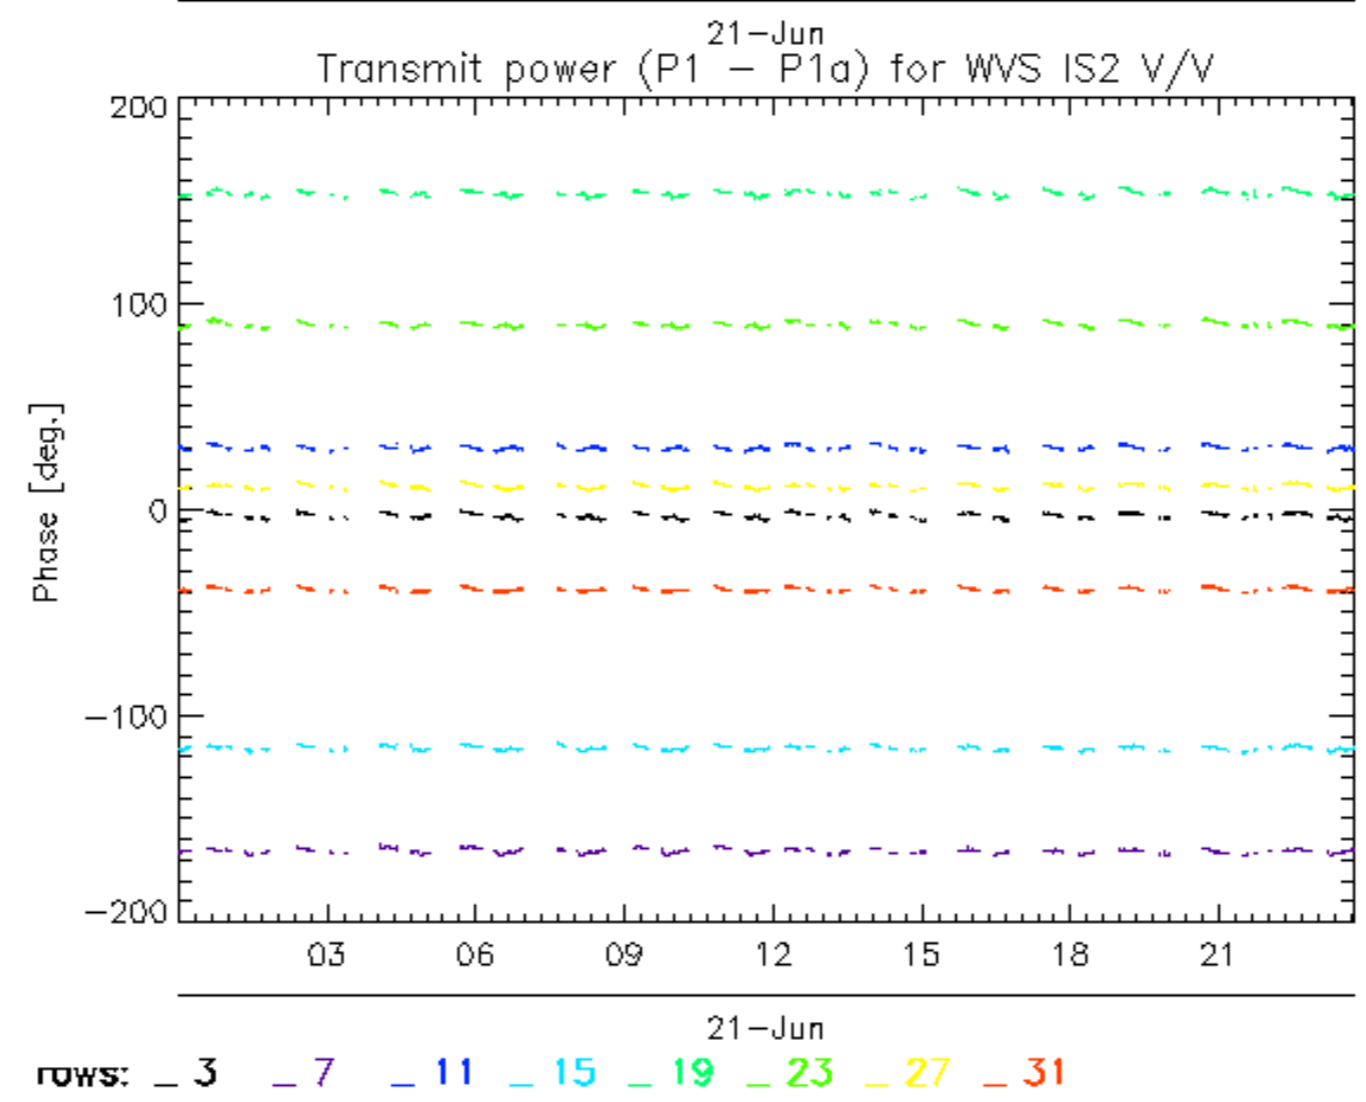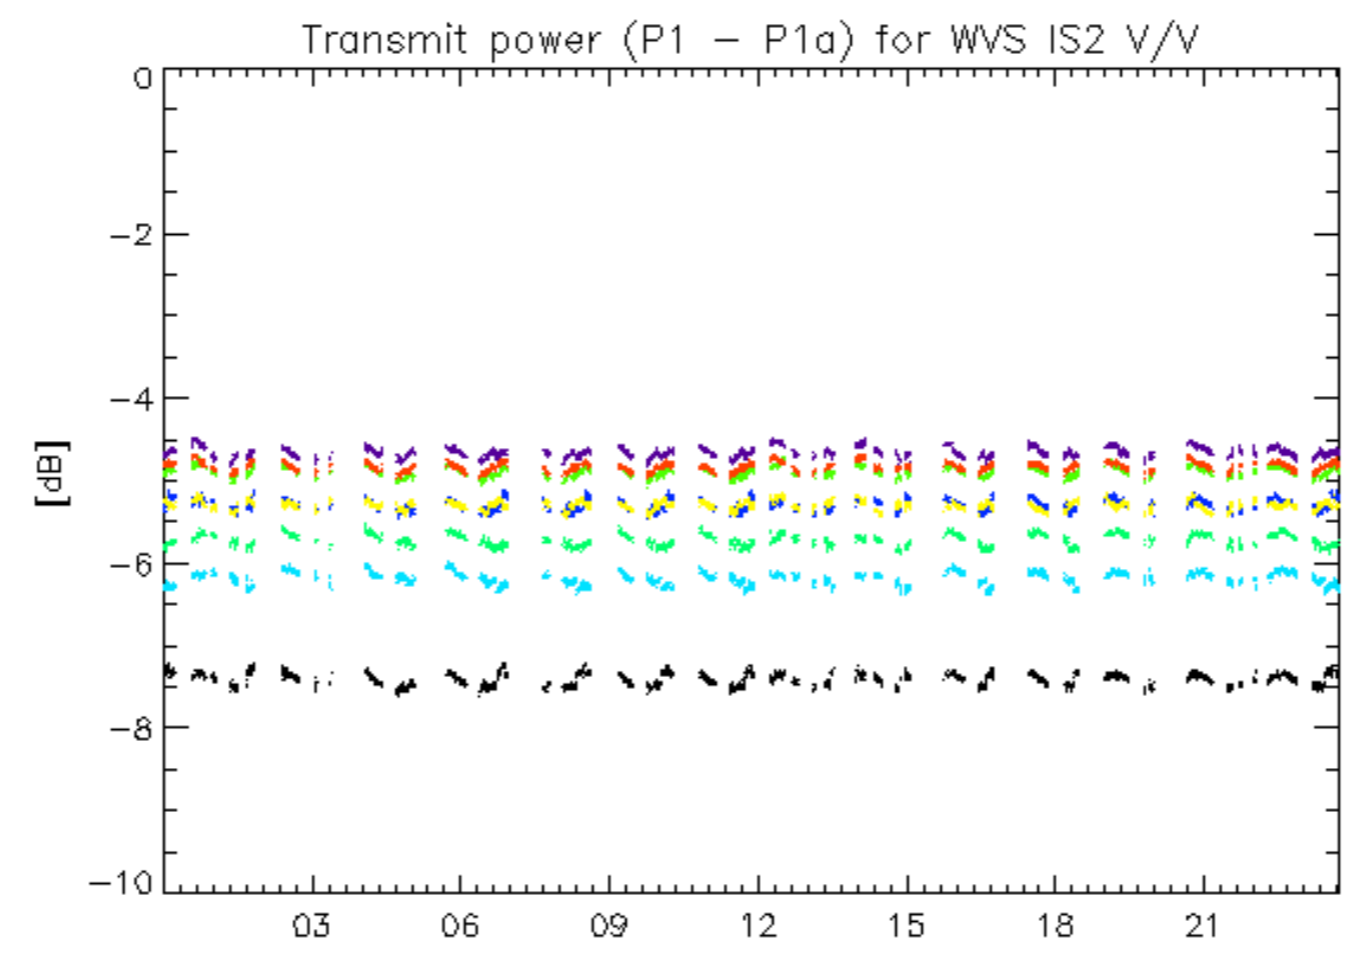

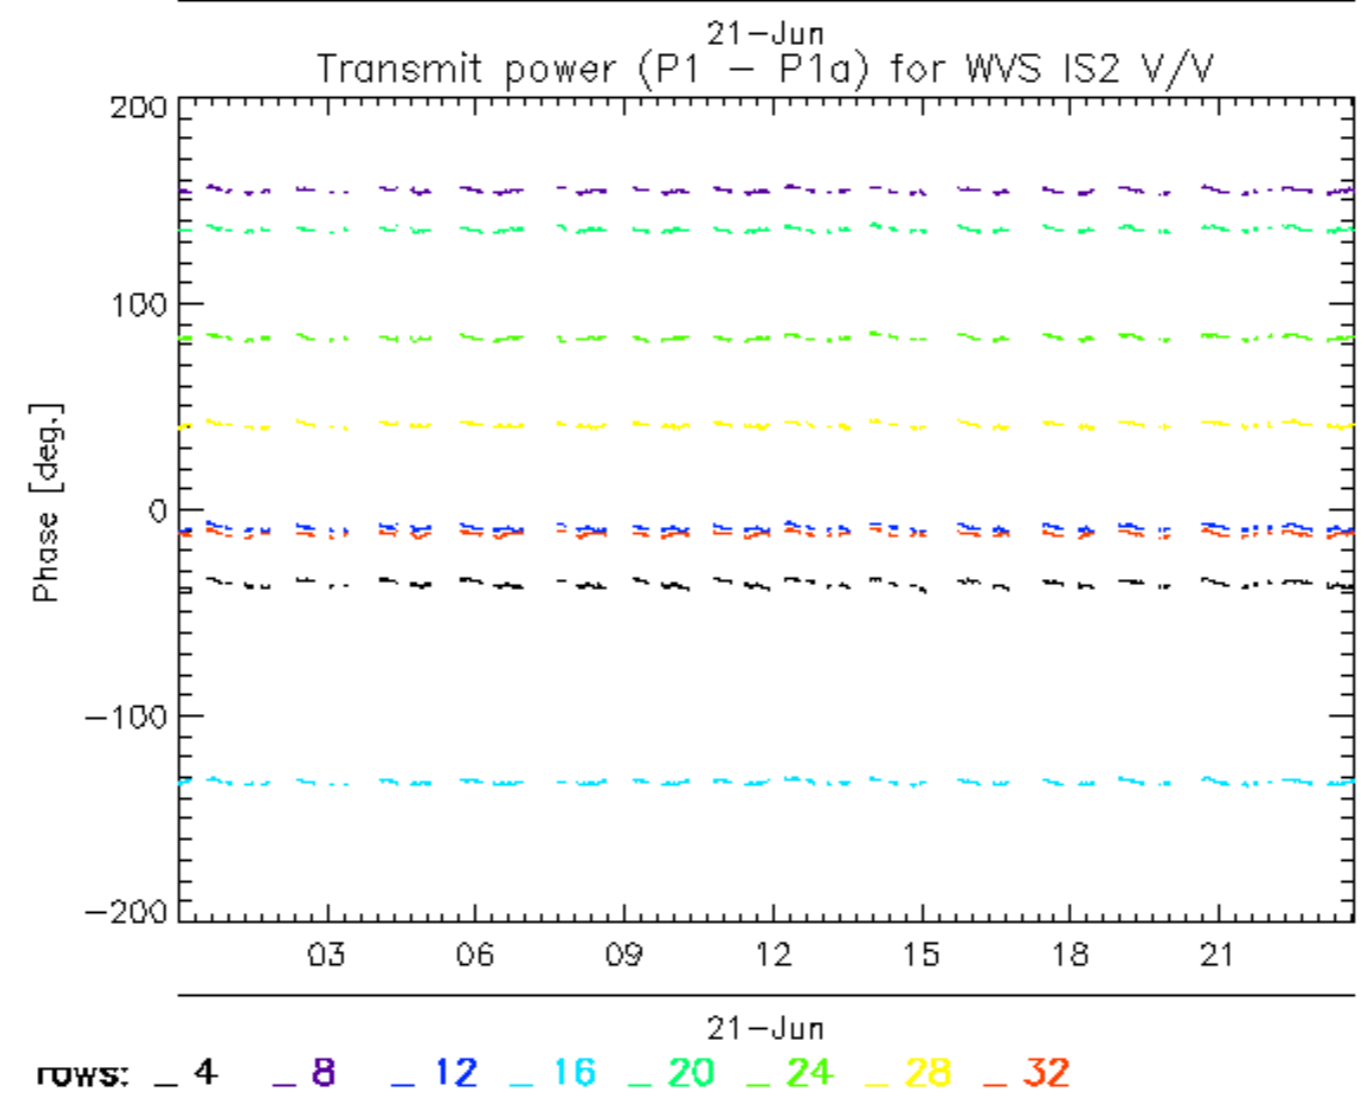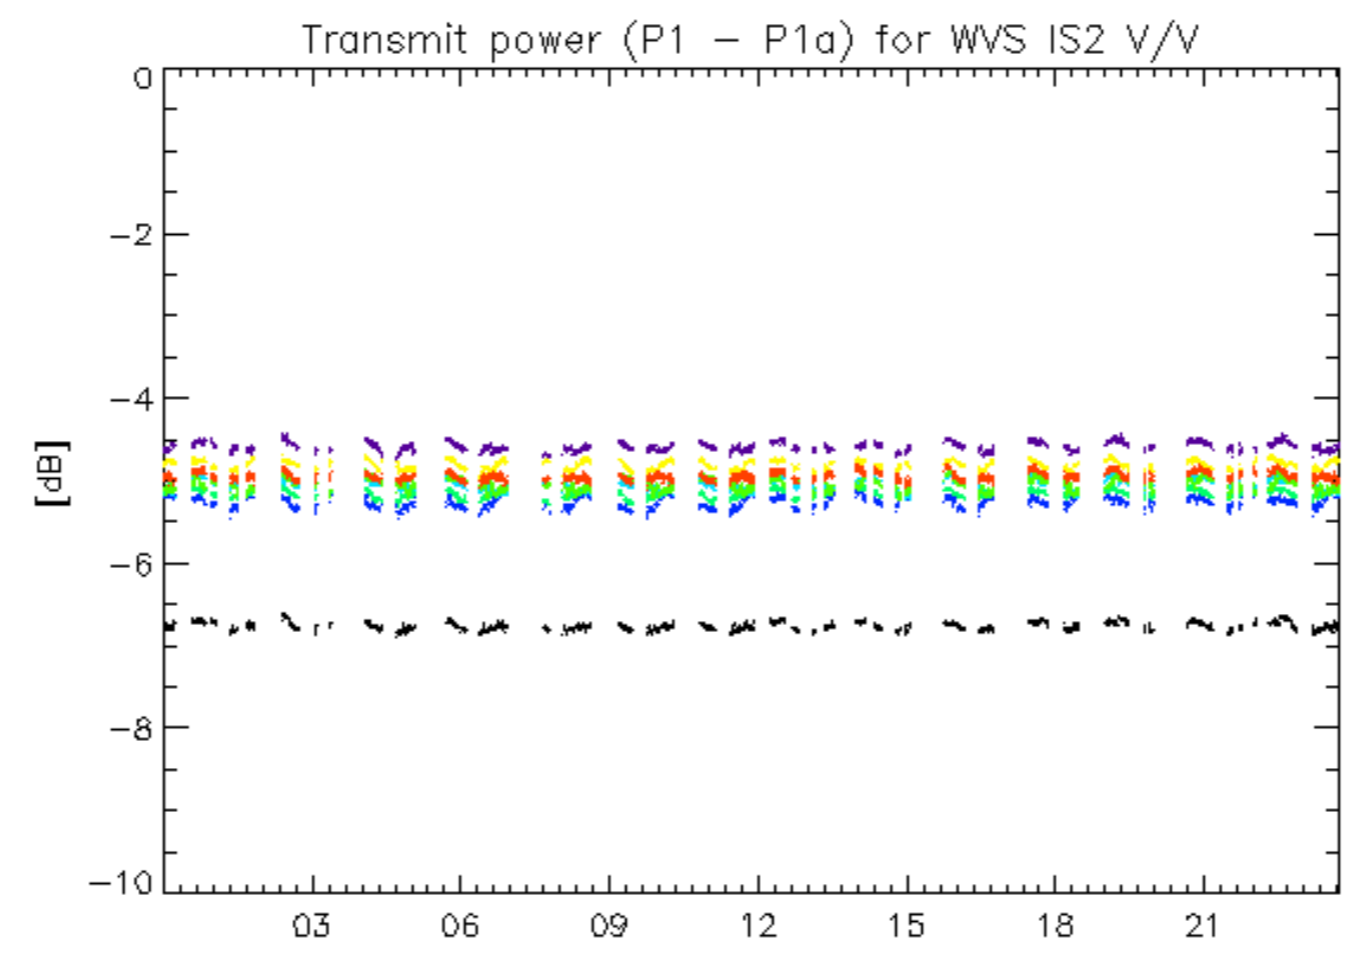

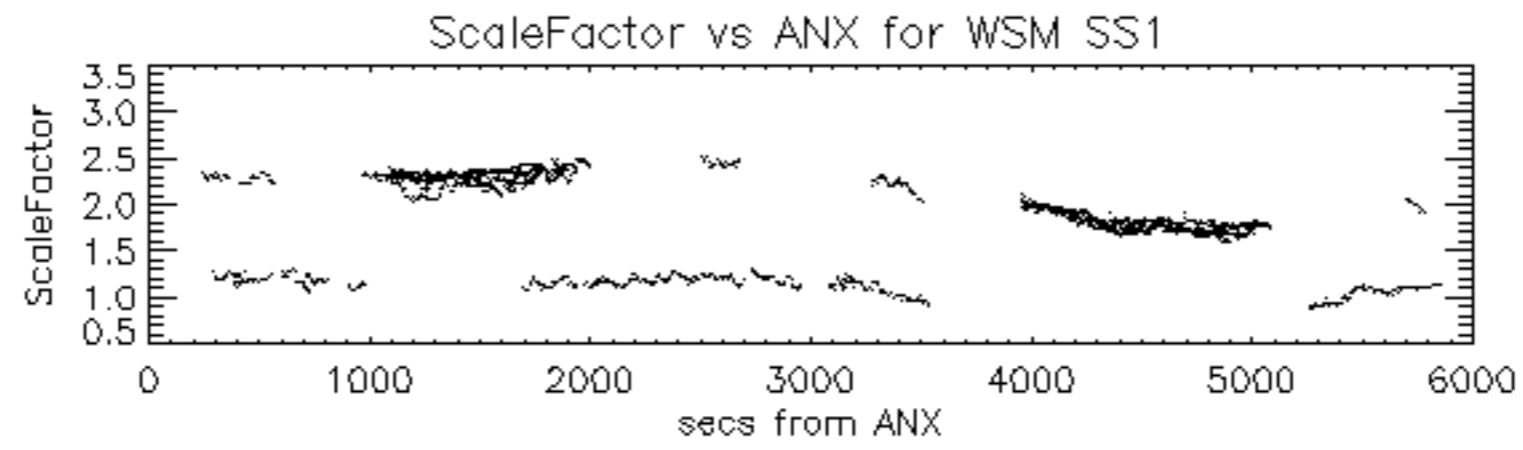



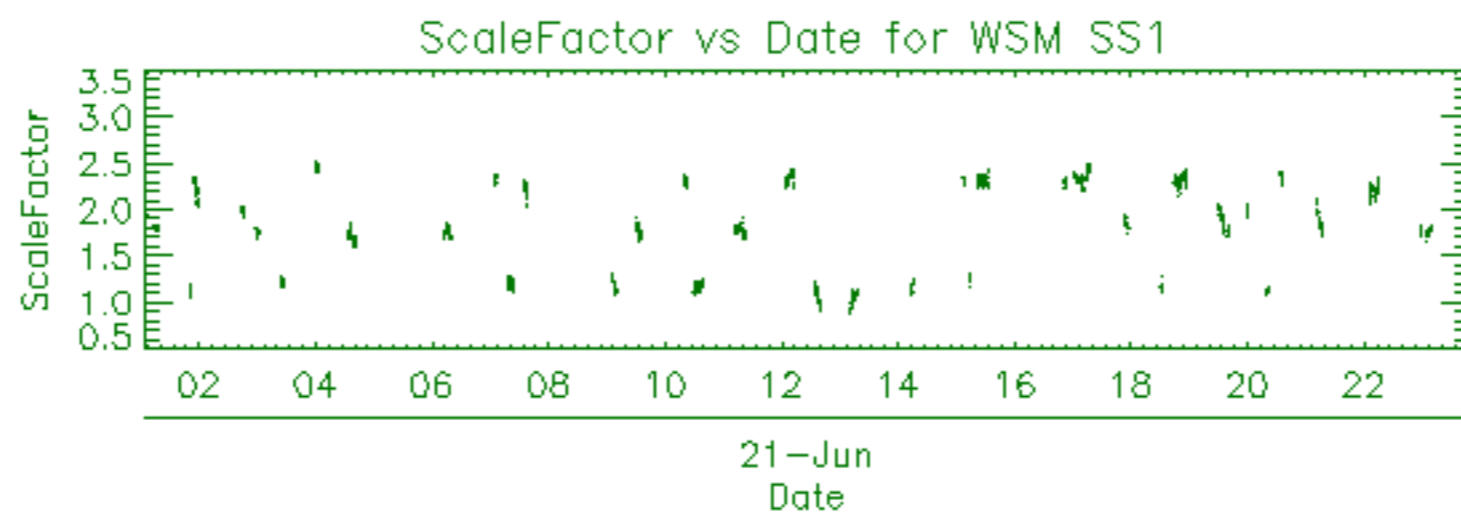

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_APM_1PNPDE20070621_072533_000001112059_00135_27744_7342.N1						IS4	H/V	59	27744	135	4.04
ASA_APM_1PNPDE20070621_085857_000000412059_00136_27745_7349.N1						IS6	H/H	59	27745	136	4.04
ASA_APM_1PNPDE20070621_104038_000000422059_00137_27746_7401.N1						IS1	H/H	59	27746	137	4.04
ASA_APM_1PNPDE20070621_150455_000000712059_00140_27749_7578.N1						IS2	H/H	59	27749	140	4.04
ASA_APM_1PNPDE20070621_165625_000000852059_00141_27750_7580.N1						IS5	H/V	59	27750	141	4.04

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_GM1_1PNPDE20070621_002038_000006462059_00131_27740_6687.N1						SS1	H/H	59	27740	131	4.04
ASA_GM1_1PNPDE20070621_005121_000003862059_00131_27740_6692.N1						SS1	H/H	59	27740	131	4.04
ASA_GM1_1PNPDE20070621_010839_000002892059_00131_27740_6694.N1						SS1	H/H	59	27740	131	4.04
ASA_GM1_1PNPDE20070621_011811_000001692059_00131_27740_6704.N1						SS1	H/H	59	27740	131	4.04
ASA_GM1_1PNPDE20070621_013114_000005012059_00131_27740_6823.N1						SS1	H/H	59	27740	131	4.04
ASA_GM1_1PNPDE20070621_015212_000001022059_00132_27741_6825.N1						SS1	H/H	59	27741	132	4.04
ASA_GM1_1PNPDE20070621_015937_000010382059_00132_27741_6902.N1						SS1	H/H	59	27741	132	4.04
ASA_GM1_1PNPDE20070621_024725_000005072059_00132_27741_6983.N1						SS1	H/H	59	27741	132	4.04
ASA_GM1_1PNPDE20070621_025645_000000782059_00132_27741_6981.N1						SS1	H/H	59	27741	132	4.04
ASA_GM1_1PNPDE20070621_030608_000001632059_00132_27741_6979.N1						SS1	H/H	59	27741	132	4.04
ASA_GM1_1PNPDE20070621_030900_000007372059_00132_27741_6977.N1						SS1	H/H	59	27741	132	4.04
ASA_GM1_1PNPDE20070621_032813_000005012059_00133_27742_6993.N1						SS1	H/H	59	27742	133	4.04
ASA_GM1_1PNPDE20070621_033757_000000782059_00133_27742_6985.N1						SS1	H/H	59	27742	133	4.04
ASA_GM1_1PNPDE20070621_034009_000010032059_00133_27742_7088.N1						SS1	H/H	59	27742	133	4.04
ASA_GM1_1PNPDE20070621_042613_000004472059_00133_27742_7163.N1						SS1	H/H	59	27742	133	4.04
ASA_GM1_1PNPDE20070621_050412_000003562059_00134_27743_7167.N1						SS1	H/H	59	27743	134	4.04
ASA_GM1_1PNPDE20070621_051133_000000722059_00134_27743_7169.N1						SS1	H/H	59	27743	134	4.04
ASA_GM1_1PNPDE20070621_051548_000001322059_00134_27743_7177.N1						SS1	H/H	59	27743	134	4.04
ASA_GM1_1PNPDE20070621_051924_000004592059_00134_27743_7179.N1						SS1	H/H	59	27743	134	4.04
ASA_GM1_1PNPDE20070621_053126_000003502059_00134_27743_7189.N1						SS1	H/H	59	27743	134	4.04
ASA_GM1_1PNPDK20070621_060649_000003022059_00134_27743_6983.N1						SS1	H/H	59	27743	134	4.04
ASA_GM1_1PNPDK20070621_062059_000001082059_00134_27743_6994.N1						SS1	H/H	59	27743	134	4.04
ASA_GM1_1PNPDK20070621_065615_000005072059_00135_27744_6996.N1						SS1	H/H	59	27744	135	4.04
ASA_GM1_1PNPDK20070621_070625_000002052059_00135_27744_7006.N1						SS1	H/H	59	27744	135	4.04
ASA_GM1_1PNPDK20070621_070908_000004652059_00135_27744_7064.N1						SS1	H/H	59	27744	135	4.04
ASA_GM1_1PNPDK20070621_072751_000003802059_00135_27744_7066.N1						SS1	H/H	59	27744	135	4.04
ASA_GM1_1PNPDK20070621_073833_000000962059_00135_27744_7068.N1						SS1	H/H	59	27744	135	4.04
ASA_GM1_1PNPDK20070621_074841_000008822059_00135_27744_7076.N1						SS1	H/H	59	27744	135	4.04
ASA_GM1_1PNPDK20070621_083835_000004042059_00136_27745_7078.N1						SS1	H/H	59	27745	136	4.04
ASA_GM1_1PNPDK20070621_084701_000002412059_00136_27745_7084.N1						SS1	H/H	59	27745	136	4.04
ASA_GM1_1PNPDK20070621_085025_000001572059_00136_27745_7199.N1						SS1	H/H	59	27745	136	4.04
ASA_GM1_1PNPDK20070621_090216_000002052059_00136_27745_7201.N1						SS1	H/H	59	27745	136	4.04
ASA_GM1_1PNPDK20070621_090959_000000842059_00136_27745_7203.N1						SS1	H/H	59	27745	136	4.04
ASA_GM1_1PNPDK20070621_092801_000001262059_00136_27745_7205.N1						SS1	H/H	59	27745	136	4.04
ASA_GM1_1PNPDK20070621_093715_000004042059_00136_27745_7210.N1						SS1	H/H	59	27745	136	4.04
ASA_GM1_1PNPDK20070621_101805_000001082059_00137_27746_7212.N1						SS1	H/H	59	27746	137	4.04
ASA_GM1_1PNPDK20070621_102338_000002172059_00137_27746_7267.N1						SS1	H/H	59	27746	137	4.04
ASA_GM1_1PNPDK20070621_104327_000003442059_00137_27746_7333.N1						SS1	H/H	59	27746	137	4.04
ASA_GM1_1PNPDK20070621_110837_000002052059_00137_27746_7338.N1						SS1	H/H	59	27746	137	4.04
ASA_GM1_1PNPDK20070621_115754_000003982059_00138_27747_7402.N1						SS1	H/H	59	27747	138	4.04
ASA_GM1_1PNPDK20070621_124912_000009242059_00138_27747_7466.N1						SS1	H/H	59	27747	138	4.04
ASA_GM1_1PNPDK20070621_133154_000009902059_00139_27748_7552.N1						SS1	H/H	59	27748	139	4.04
ASA_GM1_1PNPDK20070621_134747_000004772059_00139_27748_7597.N1						SS1	H/H	59	27748	139	4.04
ASA_GM1_1PNPDK20070621_140948_000002532059_00139_27748_7595.N1						SS1	H/H	59	27748	139	4.04
ASA_GM1_1PNPDK20070621_141548_000002112059_00139_27748_7602.N1						SS1	H/H	59	27748	139	4.04
ASA_GM1_1PNPDK20070621_142948_000009242059_00139_27748_7607.N1						SS1	H/H	59	27748	139	4.04
ASA_GM1_1PNPDK20070621_145253_000002232059_00139_27748_7612.N1						SS1	H/H	59	27748	139	4.04
ASA_GM1_1PNPDK20070621_150919_000001992059_00140_27749_7614.N1						SS1	H/H	59	27749	140	4.04
ASA_GM1_1PNPDK20070621_151524_000003262059_00140_27749_7624.N1						SS1	H/H	59	27749	140	4.04
ASA_GM1_1PNPDK20070621_153300_000001082059_00140_27749_7763.N1						SS1	H/H	59	27749	140	4.04
ASA_GM1_1PNPDK20070621_153932_000003322059_00140_27749_7768.N1						SS1	H/H	59	27749	140	4.04
ASA_GM1_1PNPDK20070621_154724_000001382059_00140_27749_7773.N1						SS1	H/H	59	27749	140	4.04
ASA_GM1_1PNPDK20070621_161024_000009242059_00140_27749_7778.N1						SS1	H/H	59	27749	140	4.04
ASA_GM1_1PNPDK20070621_164608_000002292059_00141_27750_7780.N1						SS1	H/H	59	27750	141	4.04
ASA_GM1_1PNPDK20070621_165321_000001812059_00141_27750_7782.N1						SS1	H/H	59	27750	141	4.04
ASA_GM1_1PNPDK20070621_165817_000001872059_00141_27750_7792.N1						SS1	H/H	59	27750	141	4.04
ASA_GM1_1PNPDK20070621_171707_000002352059_00141_27750_7891.N1						SS1	H/H	59	27750	141	4.04
ASA_GM1_1PNPDK20070621_172209_000002592059_00141_27750_7899.N1						SS1	H/H	59	27750	141	4.04
ASA_GM1_1PNPDK20070621_175100_000001262059_00141_27750_7901.N1						SS1	H/H	59	27750	141	4.04
ASA_GM1_1PNPDK20070621_175750_000005492059_00141_27750_7908.N1						SS1	H/H	59	27750	141	4.04
ASA_GM1_1PNPDK20070621_182834_000000962059_00142_27751_7906.N1						SS1	H/H	59	27751	142	4.04
ASA_GM1_1PNPDK20070621_183136_000002292059_00142_27751_7910.N1						SS1	H/H	59	27751	142	4.04
ASA_GM1_1PNPDK20070621_183853_000001872059_00142_27751_7917.N1						SS1	H/H	59	27751	142	4.04
ASA_GM1_1PNPDK20070621_184057_000001752059_00142_27751_8016.N1						SS1	H/H	59	27751	142	4.04
ASA_GM1_1PNPDK20070621_185641_000001992059_00142_27751_8020.N1						SS1	H/H	59	27751	142	4.04
ASA_GM1_1PNPDK20070621_193725_000000962059_00142_27751_8018.N1						SS1	H/H	59	27751	142	4.04
ASA_GM1_1PNPDK20070621_194046_000004042059_00142_27751_8022.N1						SS1	H/H	59	27751	142	4.04

ASA_GM1_1PNPDK20070621_200040_000007372059_00142_27751_8030.N1	SS1	H/H	59	27751	142	4.04
ASA_GM1_1PNPDK20070621_201709_000001022059_00143_27752_8042.N1	SS1	H/H	59	27752	143	4.04
ASA_GM1_1PNPDE20070621_202114_000007372059_00143_27752_7674.N1	SS1	H/H	59	27752	143	4.04
ASA_GM1_1PNPDE20070621_203617_000001442059_00143_27752_7672.N1	SS1	H/H	59	27752	143	4.04
ASA_GM1_1PNPDE20070621_211800_000006102059_00143_27752_7687.N1	SS1	H/H	59	27752	143	4.04
ASA_GM1_1PNPDE20070621_214620_000004592059_00144_27753_7800.N1	SS1	H/H	59	27753	144	4.04
ASA_GM1_1PNPDE20070621_221505_000001502059_00144_27753_7805.N1	SS1	H/H	59	27753	144	4.04
ASA_GM1_1PNPDE20070621_225248_000002592059_00144_27753_7807.N1	SS1	H/H	59	27753	144	4.04
ASA_GM1_1PNPDE20070621_225955_000002592059_00144_27753_7820.N1	SS1	H/H	59	27753	144	4.04
ASA_GM1_1PNPDE20070621_234824_000007852059_00145_27754_7951.N1	SS1	H/H	59	27754	145	4.04

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20070621_001403_000003782059_00131_27740_6910.N1						IS2	H/H	59	27740	131	4.04
ASA_IMM_1PNPDE20070621_003246_000000502059_00131_27740_6783.N1						IS7	V/V	59	27740	131	4.04
ASA_IMM_1PNPDE20070621_021653_000000822059_00132_27741_6931.N1						IS2	V/V	59	27741	132	4.04
ASA_IMM_1PNPDE20070621_021924_000000502059_00132_27741_6914.N1						IS4	V/V	59	27741	132	4.04
ASA_IMM_1PNPDE20070621_022058_000000952059_00132_27741_6929.N1						IS2	V/V	59	27741	132	4.04
ASA_IMM_1PNPDE20070621_025552_000000362059_00132_27741_6924.N1						IS1	H/H	59	27741	132	4.04
ASA_IMM_1PNPDE20070621_033916_000000352059_00133_27742_7123.N1						IS6	V/V	59	27742	133	4.04
ASA_IMM_1PNPDE20070621_035654_000001812059_00133_27742_7147.N1						IS2	V/V	59	27742	133	4.04
ASA_IMM_1PNPDE20070621_051010_000000662059_00134_27743_7264.N1						IS2	V/V	59	27743	134	4.04
ASA_IMM_1PNPDE20070621_051248_000000362059_00134_27743_7254.N1						IS2	H/H	59	27743	134	4.04
ASA_IMM_1PNPDE20070621_051440_000000502059_00134_27743_7260.N1						IS6	V/V	59	27743	134	4.04
ASA_IMM_1PNPDE20070621_053715_000002602059_00134_27743_7279.N1						IS2	V/V	59	27743	134	4.04
ASA_IMM_1PNPDK20070621_082520_000000602059_00136_27745_7166.N1						IS4	V/V	59	27745	136	4.04
ASA_IMM_1PNPDE20070621_090054_000000612059_00136_27745_7351.N1						IS5	H/H	59	27745	136	4.04
ASA_IMM_1PNPDK20070621_102718_000000362059_00137_27746_7214.N1						IS2	H/H	59	27746	137	4.04
ASA_IMM_1PNPDE20070621_115605_000000502059_00138_27747_7458.N1						IS2	V/V	59	27747	138	4.04
ASA_IMM_1PNPDK20070621_121326_000000512059_00138_27747_7422.N1						IS2	V/V	59	27747	138	4.04
ASA_IMM_1PNPDE20070621_171229_000000372059_00141_27750_7591.N1						IS5	H/H	59	27750	141	4.04
ASA_IMM_1PNPDE20070621_172102_000000512059_00141_27750_7595.N1						IS2	V/V	59	27750	141	4.04
ASA_IMM_1PNPDE20070621_201300_000000352059_00143_27752_7670.N1						IS6	H/H	59	27752	143	4.04
ASA_IMM_1PNPDK20070621_201850_000000362059_00143_27752_8032.N1						IS4	V/V	59	27752	143	4.04
ASA_IMM_1PNPDK20070621_220311_000000662059_00144_27753_8129.N1						IS2	H/H	59	27753	144	4.04


Filename	Pol	Timestamp	count(Module)
ASA_MS__0PNPDK20070621_074717_000000162059_00135_27744_0316.N1	V	2007-06-21 07:47:17	320





Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WSM_1PNPDE20070621_010411_000002442059_00131_27740_6804.N1						SS1	H/H	59	27740	131	4.04
ASA_WSM_1PNPDE20070621_011337_000002632059_00131_27740_6908.N1						SS1	H/H	59	27740	131	4.04
ASA_WSM_1PNPDE20070621_014938_000001282059_00132_27741_6912.N1						SS1	V/V	59	27741	132	4.04
ASA_WSM_1PNPDE20070621_015403_000003242059_00132_27741_7108.N1						SS1	H/H	59	27741	132	4.04
ASA_WSM_1PNPDE20070621_024351_000002022059_00132_27741_6969.N1						SS1	H/H	59	27741	132	4.04
ASA_WSM_1PNPDE20070621_025813_000002812059_00132_27741_7149.N1						SS1	H/H	59	27741	132	4.04
ASA_WSM_1PNPDE20070621_032329_000002752059_00133_27742_7262.N1						SS1	V/V	59	27742	133	4.04
ASA_WSM_1PNPDE20070621_040019_000001842059_00133_27742_7165.N1						SS1	H/H	59	27742	133	4.04
ASA_WSM_1PNPDE20070621_043349_000005002059_00133_27742_7384.N1						SS1	H/H	59	27742	133	4.04
ASA_WSM_1PNPDE20070621_043456_000004342059_00133_27742_7320.N1						SS1	H/H	59	27742	133	4.04
ASA_WSM_1PNPDK20070621_061203_000005242059_00134_27743_7062.N1						SS1	H/H	59	27743	134	4.04
ASA_WSM_1PNPDE20070621_070451_000000852059_00135_27744_7353.N1						SS1	H/H	59	27744	135	4.04
ASA_WSM_1PNPDE20070621_070558_000000182059_00135_27744_7316.N1						SS1	H/H	59	27744	135	4.04
ASA_WSM_1PNPDE20070621_071705_000004762059_00135_27744_7386.N1						SS1	V/V	59	27744	135	4.04
ASA_WSM_1PNPDE20070621_073419_000002442059_00135_27744_7484.N1						SS1	H/H	59	27744	135	4.04
ASA_WSM_1PNPDE20070621_090553_000002392059_00136_27745_7388.N1						SS1	V/V	59	27745	136	4.04
ASA_WSM_1PNPDE20070621_093015_000004092059_00136_27745_7478.N1						SS1	H/H	59	27745	136	4.04
ASA_WSM_1PNPDE20070621_102004_000002012059_00137_27746_7512.N1						SS1	H/H	59	27746	137	4.04
ASA_WSM_1PNPDE20070621_102111_000001332059_00137_27746_7444.N1						SS1	H/H	59	27746	137	4.04
ASA_WSM_1PNPDK20070621_102907_000002632059_00137_27746_7323.N1						SS1	V/V	59	27746	137	4.04
ASA_WSM_1PNPDK20070621_103351_000002752059_00137_27746_7331.N1						SS1	V/V	59	27746	137	4.04
ASA_WSM_1PNPDE20070621_111211_000002632059_00137_27746_7447.N1						SS1	H/H	59	27746	137	4.04
ASA_WSM_1PNPDE20070621_111713_000003852059_00137_27746_7518.N1						SS1	H/H	59	27746	137	4.04
ASA_WSM_1PNPDK20070621_120441_000005242059_00138_27747_7562.N1						SS1	H/H	59	27747	138	4.04
ASA_WSM_1PNPDE20070621_123257_000002442059_00138_27747_7514.N1						SS1	V/V	59	27747	138	4.04
ASA_WSM_1PNPDE20070621_123257_000004702059_00138_27747_7540.N1						SS1	V/V	59	27747	138	4.04
ASA_WSM_1PNPDE20070621_123803_000001632059_00138_27747_7515.N1						SS1	V/V	59	27747	138	4.04
ASA_WSM_1PNPDK20070621_130914_000006052059_00138_27747_7593.N1						SS1	V/V	59	27747	138	4.04
ASA_WSM_1PNPDE20070621_141415_000000852059_00139_27748_7566.N1						SS1	V/V	59	27748	139	4.04
ASA_WSM_1PNPDE20070621_150645_000001472059_00140_27749_7582.N1						SS1	H/H	59	27749	140	4.04
ASA_WSM_1PNPDE20070621_151249_000001412059_00140_27749_7593.N1						SS1	V/V	59	27749	140	4.04
ASA_WSM_1PNPDK20070621_152101_000000852059_00140_27749_7714.N1						SS1	H/H	59	27749	140	4.04
ASA_WSM_1PNPDK20070621_152251_000005932059_00140_27749_7761.N1						SS1	H/H	59	27749	140	4.04
ASA_WSM_1PNPDE20070621_165009_000001832059_00141_27750_7585.N1						SS1	H/H	59	27750	141	4.04
ASA_WSM_1PNPDK20070621_170135_000005812059_00141_27750_7889.N1						SS1	H/H	59	27750	141	4.04
ASA_WSM_1PNPDE20070621_170935_000001162059_00141_27750_7587.N1						SS1	H/H	59	27750	141	4.04
ASA_WSM_1PNPDE20070621_171353_000001832059_00141_27750_7627.N1						SS1	H/H	59	27750	141	4.04
ASA_WSM_1PNPDE20070621_171500_000001152059_00141_27750_7621.N1						SS1	H/H	59	27750	141	4.04
ASA_WSM_1PNPDE20070621_175316_000002612059_00141_27750_7632.N1						SS1	H/H	59	27750	141	4.04
ASA_WSM_1PNPDE20070621_183021_000000672059_00142_27751_7664.N1						SS1	V/V	59	27751	142	4.04
ASA_WSM_1PNPDK20070621_184404_000003912059_00142_27751_8014.N1						SS1	H/H	59	27751	142	4.04
ASA_WSM_1PNPDE20070621_184936_000002322059_00142_27751_7634.N1						SS1	H/H	59	27751	142	4.04
ASA_WSM_1PNPDE20070621_185404_000001462059_00142_27751_7668.N1						SS1	H/H	59	27751	142	4.04
ASA_WSM_1PNPDE20070621_192952_000004462059_00142_27751_7774.N1						SS1	H/H	59	27751	142	4.04
ASA_WSM_1PNPDE20070621_193913_000000852059_00142_27751_7636.N1						SS1	H/H	59	27751	142	4.04
ASA_WSM_1PNPDE20070621_195857_000000912059_00142_27751_7666.N1						SS1	H/H	59	27751	142	4.04
ASA_WSM_1PNPDK20070621_201940_000000852059_00143_27752_8114.N1						SS1	V/V	59	27752	143	4.04
ASA_WSM_1PNPDE20070621_203340_000001462059_00143_27752_7792.N1						SS1	H/H	59	27752	143	4.04
ASA_WSM_1PNPDE20070621_211027_000004462059_00143_27752_7899.N1						SS1	H/H	59	27752	143	4.04
ASA_WSM_1PNPDK20070621_220503_000002692059_00144_27753_8141.N1						SS1	H/H	59	27753	144	4.04
ASA_WSM_1PNPDE20070621_220825_000003912059_00144_27753_8048.N1						SS1	H/H	59	27753	144	4.04
ASA_WSM_1PNPDE20070621_225721_000001462059_00144_27753_7894.N1						SS1	H/H	59	27753	144	4.04
ASA_WSM_1PNPDE20070621_230424_000003422059_00144_27753_7958.N1						SS1	H/H	59	27753	144	4.04
ASA_WSM_1PNPDE20070621_234338_000001292059_00145_27754_8370.N1						SS1	H/H	59	27754	145	4.04
ASA_WSM_1PNPDK20070621_234415_000002392059_00145_27754_8151.N1						SS1	H/H	59	27754	145	4.04
ASA_WSM_1PNPDE20070621_234446_000000612059_00145_27754_7941.N1						SS1	H/H	59	27754	145	4.04


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20070620_234427_000017392059_00130_27739_6685.N1						IS2	V/V	59	27739	130	4.04
ASA_WVS_1PNPDE20070621_003343_000010062059_00131_27740_6690.N1						IS2	V/V	59	27740	131	4.04
ASA_WVS_1PNPDE20070621_005747_000003302059_00131_27740_6697.N1						IS2	V/V	59	27740	131	4.04
ASA_WVS_1PNPDE20070621_012059_000002842059_00131_27740_6707.N1						IS2	V/V	59	27740	131	4.04
ASA_WVS_1PNPDE20070621_012444_000003452059_00131_27740_6821.N1						IS2	V/V	59	27740	131	4.04
ASA_WVS_1PNPDE20070621_012059_000002842059_00131_27740_6707.N1						IS1	V/V	59	27740	131	4.04
ASA_WVS_1PNPDE20070621_013939_000005542059_00132_27741_6828.N1						IS2	V/V	59	27741	132	4.04
ASA_WVS_1PNPDE20070621_022240_000008992059_00132_27741_6840.N1						IS2	V/V	59	27741	132	4.04
ASA_WVS_1PNPDE20070621_023724_000003302059_00132_27741_6975.N1						IS2	V/V	59	27741	132	4.04
ASA_WVS_1PNPDE20070621_030254_000001502059_00132_27741_6972.N1						IS2	V/V	59	27741	132	4.04
ASA_WVS_1PNPDE20070621_032123_000000742059_00133_27742_6996.N1						IS2	V/V	59	27742	133	4.04
ASA_WVS_1PNPDE20070621_040321_000010042059_00133_27742_7014.N1						IS2	V/V	59	27742	133	4.04
ASA_WVS_1PNPDE20070621_041936_000001042059_00133_27742_7158.N1						IS2	V/V	59	27742	133	4.04
ASA_WVS_1PNPDE20070621_040321_000010042059_00133_27742_7014.N1						IS1	V/V	59	27742	133	4.04
ASA_WVS_1PNPDE20070621_042435_000000452059_00133_27742_7161.N1						IS2	V/V	59	27742	133	4.04
ASA_WVS_1PNPDE20070621_044213_000012742059_00133_27742_7182.N1						IS2	V/V	59	27742	133	4.04
ASA_WVS_1PNPDE20070621_054236_000010342059_00134_27743_7192.N1						IS2	V/V	59	27743	134	4.04
ASA_WVS_1PNPDK20070621_055921_000004052059_00134_27743_6986.N1						IS2	V/V	59	27743	134	4.04
ASA_WVS_1PNPDE20070621_054236_000010342059_00134_27743_7192.N1						IS1	V/V	59	27743	134	4.04
ASA_WVS_1PNPDK20070621_062247_000019642059_00134_27743_6999.N1						IS2	V/V	59	27743	134	4.04
ASA_WVS_1PNPDK20070621_074009_000003902059_00135_27744_7071.N1						IS2	V/V	59	27744	135	4.04
ASA_WVS_1PNPDK20070621_080323_000012742059_00135_27744_7074.N1						IS2	V/V	59	27744	135	4.04
ASA_WVS_1PNPDK20070621_082630_000006742059_00136_27745_7140.N1						IS2	V/V	59	27745	136	4.04
ASA_WVS_1PNPDK20070621_091123_000009442059_00136_27745_7208.N1						IS2	V/V	59	27745	136	4.04
ASA_WVS_1PNPDK20070621_094359_000019942059_00136_27745_7265.N1						IS2	V/V	59	27745	136	4.04
ASA_WVS_1PNPDK20070621_104910_000011092059_00137_27746_7336.N1						IS2	V/V	59	27746	137	4.04
ASA_WVS_1PNPDK20070621_112426_000018592059_00137_27746_7347.N1						IS2	V/V	59	27746	137	4.04
ASA_WVS_1PNPDK20070621_121424_000010642059_00138_27747_7440.N1						IS2	V/V	59	27747	138	4.04
ASA_WVS_1PNPDK20070621_124132_000004052059_00138_27747_7443.N1						IS2	V/V	59	27747	138	4.04
ASA_WVS_1PNPDK20070621_130511_000001952059_00138_27747_7446.N1						IS2	V/V	59	27747	138	4.04
ASA_WVS_1PNPDK20070621_131916_000007022059_00138_27747_7478.N1						IS2	V/V	59	27747	138	4.04
ASA_WVS_1PNPDK20070621_135818_000006442059_00139_27748_7600.N1						IS2	V/V	59	27748	139	4.04
ASA_WVS_1PNPDK20070621_141923_000005702059_00139_27748_7605.N1						IS2	V/V	59	27748	139	4.04
ASA_WVS_1PNPDK20070621_144547_000003752059_00139_27748_7610.N1						IS2	V/V	59	27748	139	4.04
ASA_WVS_1PNPDK20070621_145636_000004642059_00139_27748_7617.N1						IS2	V/V	59	27748	139	4.04
ASA_WVS_1PNPDK20070621_154506_000000892059_00140_27749_7766.N1						IS2	V/V	59	27749	140	4.04
ASA_WVS_1PNPDK20070621_154942_000001342059_00140_27749_7771.N1						IS2	V/V	59	27749	140	4.04
ASA_WVS_1PNPDK20070621_155410_000009292059_00140_27749_7776.N1						IS2	V/V	59	27749	140	4.04
ASA_WVS_1PNPDK20070621_162623_000011392059_00140_27749_7785.N1						IS2	V/V	59	27749	140	4.04
ASA_WVS_1PNPDK20070621_172632_000014242059_00141_27750_7904.N1						IS2	V/V	59	27750	141	4.04
ASA_WVS_1PNPDK20070621_181046_000010192059_00141_27750_7920.N1						IS2	V/V	59	27750	141	4.04
ASA_WVS_1PNPDK20070621_190001_000017392059_00142_27751_8028.N1						IS2	V/V	59	27751	142	4.04
ASA_WVS_1PNPDK20070621_194735_000000902059_00142_27751_8025.N1						IS2	V/V	59	27751	142	4.04
ASA_WVS_1PNPDK20070621_195223_000003442059_00142_27751_8040.N1						IS2	V/V	59	27751	142	4.04
ASA_WVS_1PNPDE20070621_203847_000018442059_00143_27752_7677.N1						IS2	V/V	59	27752	143	4.04
ASA_WVS_1PNPDE20070621_212811_000002402059_00143_27752_7685.N1						IS2	V/V	59	27752	143	4.04
ASA_WVS_1PNPDE20070621_213111_000002402059_00143_27752_7795.N1						IS2	V/V	59	27752	143	4.04
ASA_WVS_1PNPDE20070621_214122_000002542059_00143_27752_7798.N1						IS2	V/V	59	27752	143	4.04
ASA_WVS_1PNPDE20070621_215936_000001802059_00144_27753_7803.N1						IS2	V/V	59	27753	144	4.04
ASA_WVS_1PNPDE20070621_221736_000020542059_00144_27753_7810.N1						IS2	V/V	59	27753	144	4.04
ASA_WVS_1PNPDE20070621_231005_000002542059_00144_27753_7813.N1						IS2	V/V	59	27753	144	4.04
ASA_WVS_1PNPDE20070621_231320_000013342059_00144_27753_7946.N1						IS2	V/V	59	27753	144	4.04
ASA_WVS_1PNPDE20070621_231005_000002542059_00144_27753_7813.N1						IS1	V/V	59	27753	144	4.04
ASA_WVS_1PNPDE20070621_233710_000003452059_00145_27754_7949.N1						IS2	V/V	59	27754	145	4.04








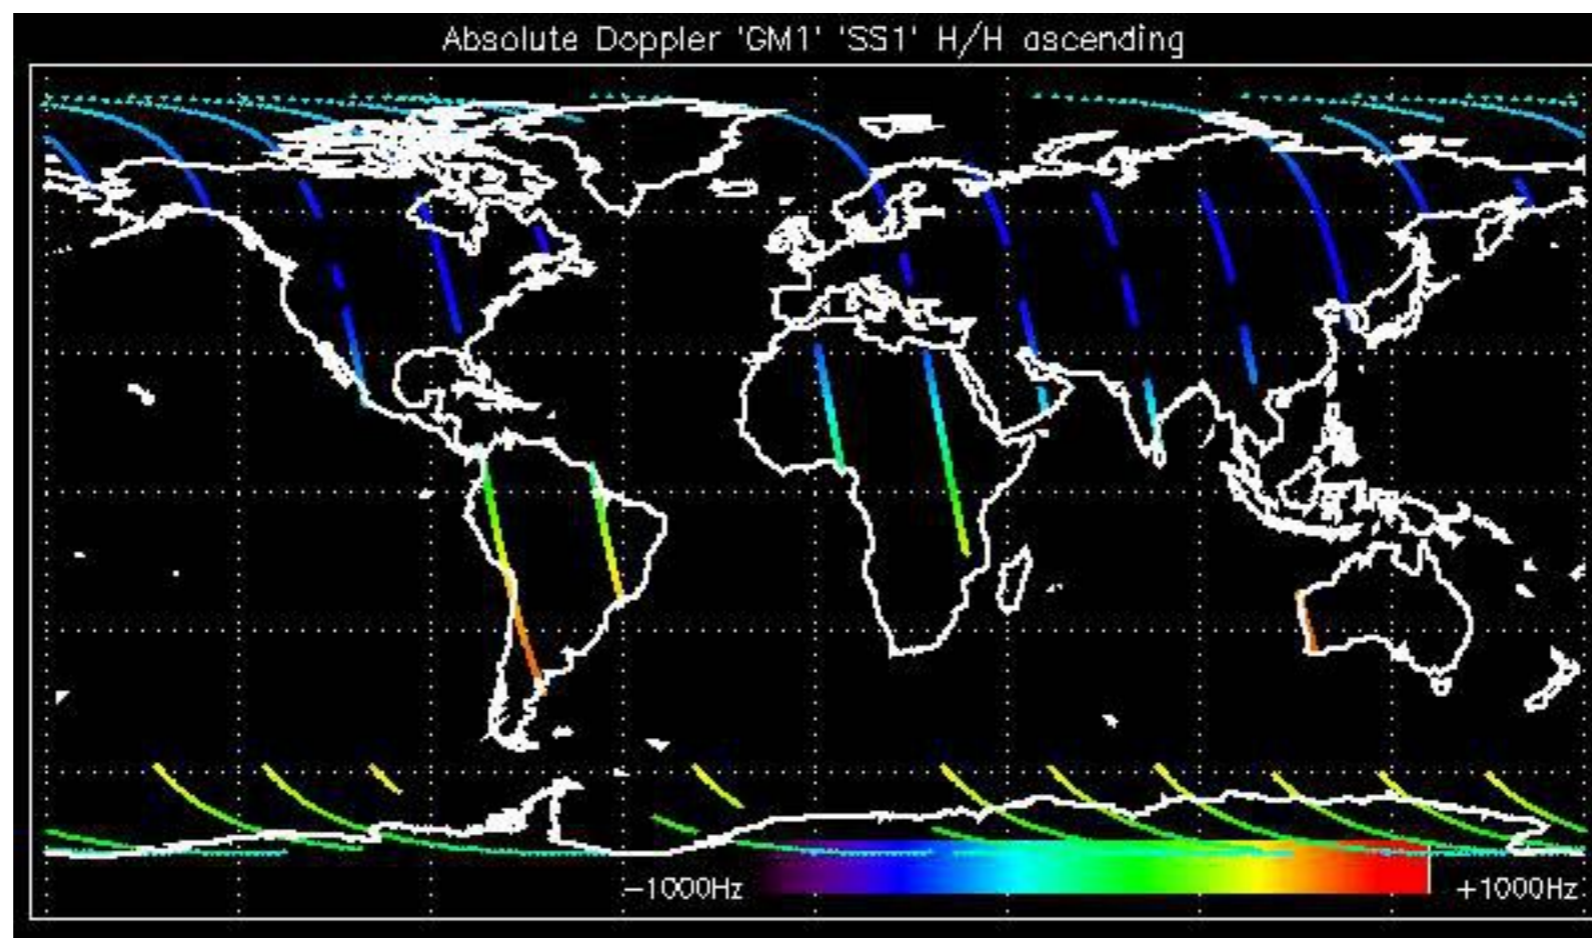


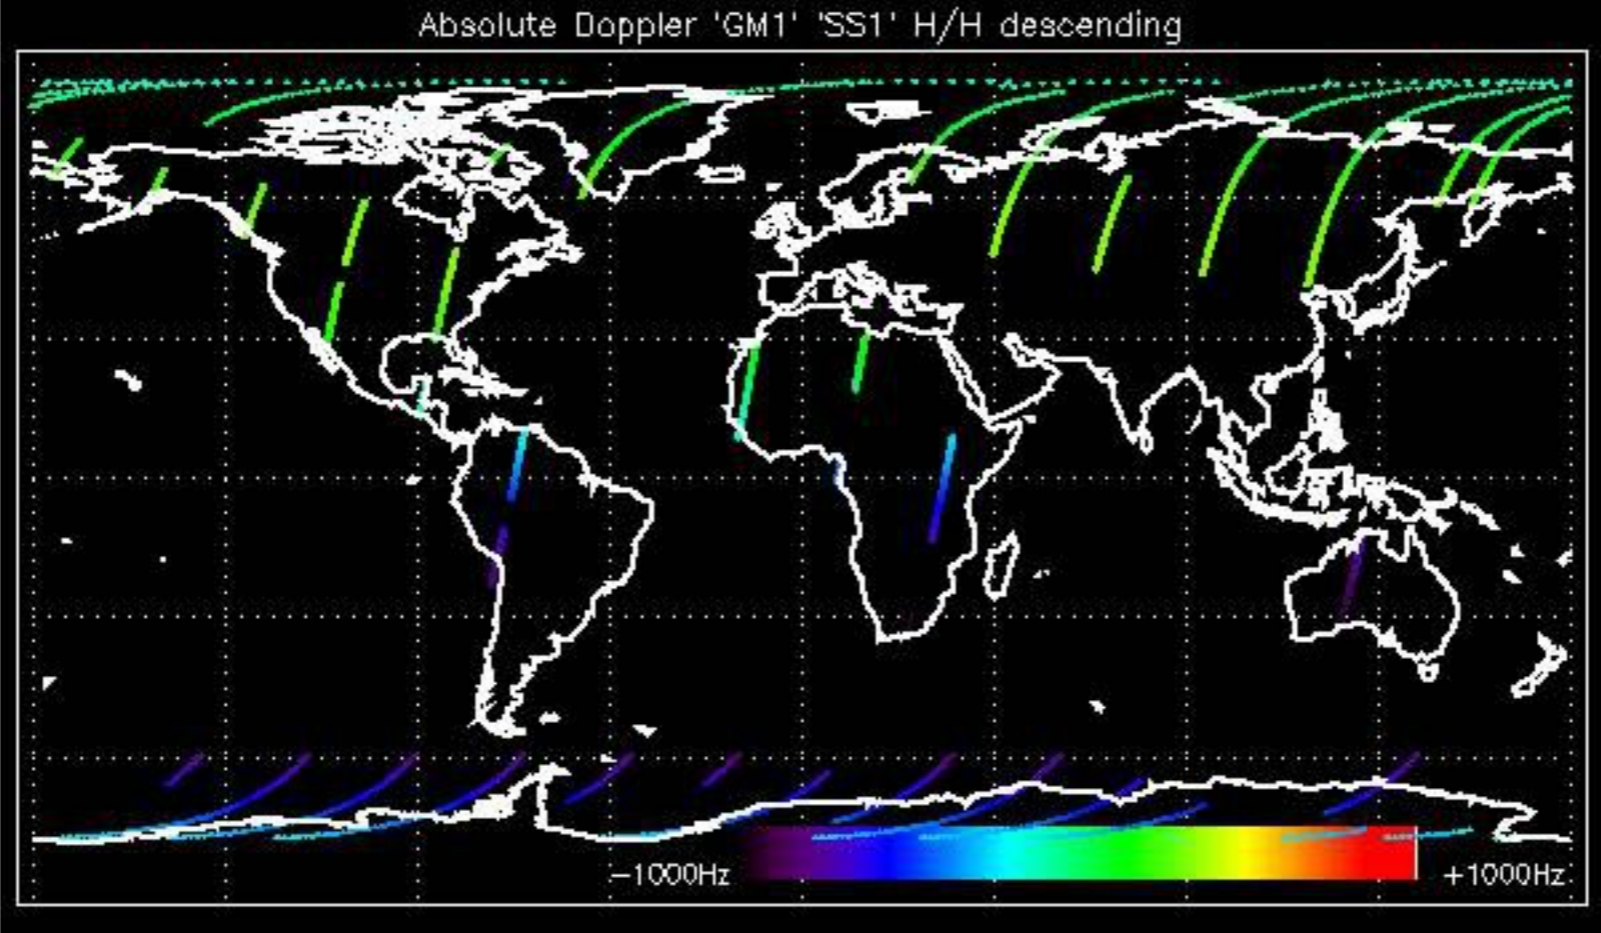


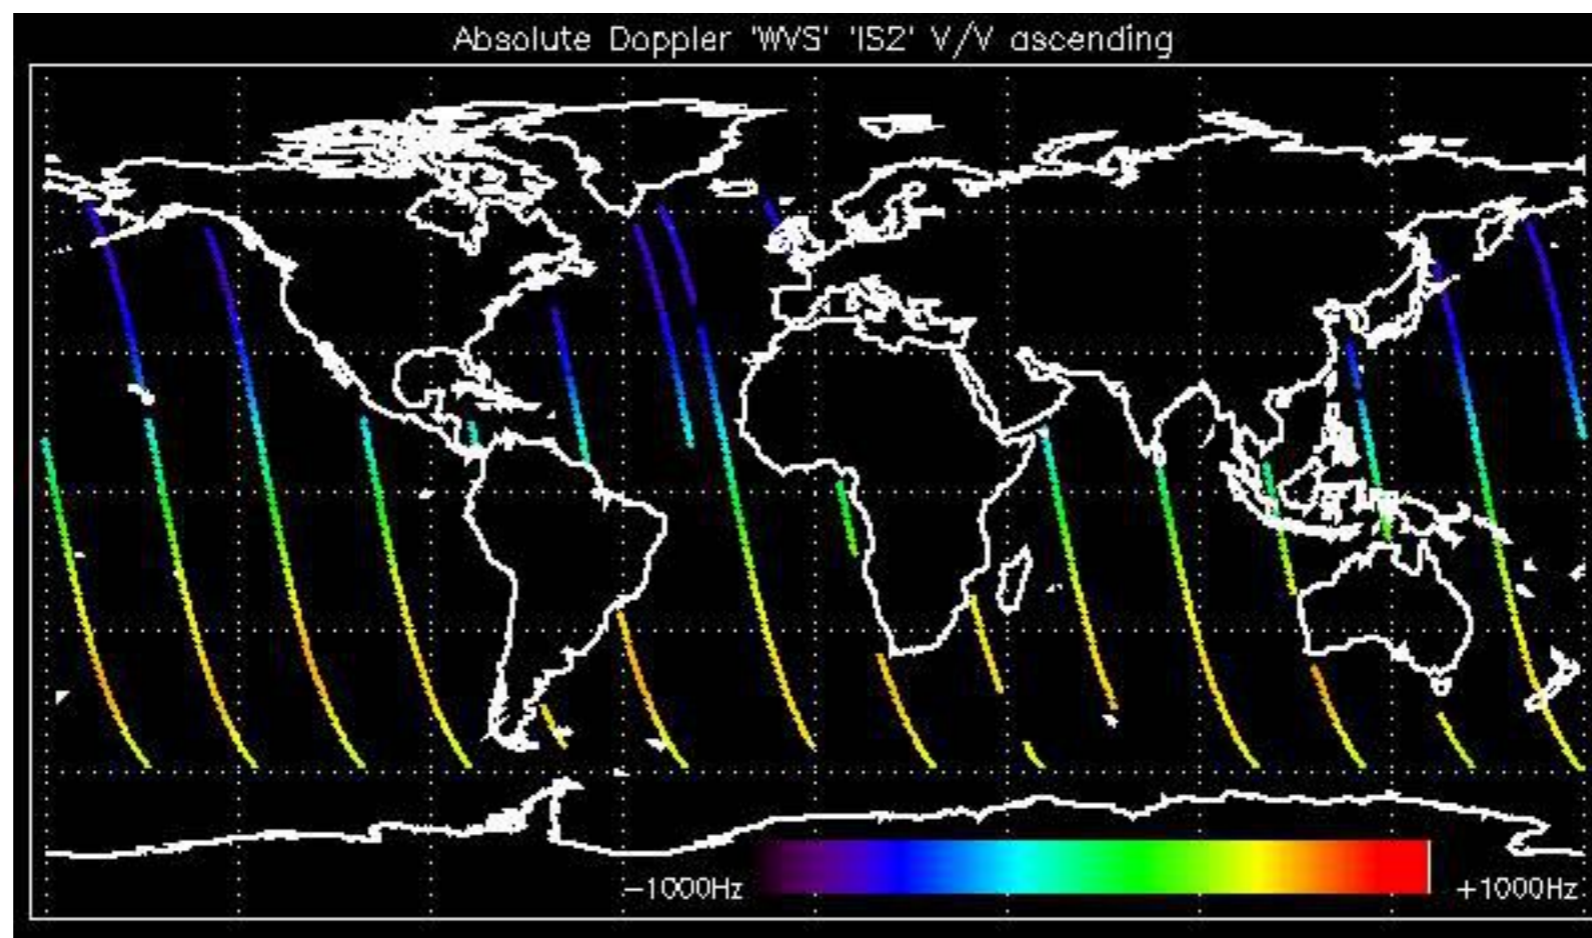


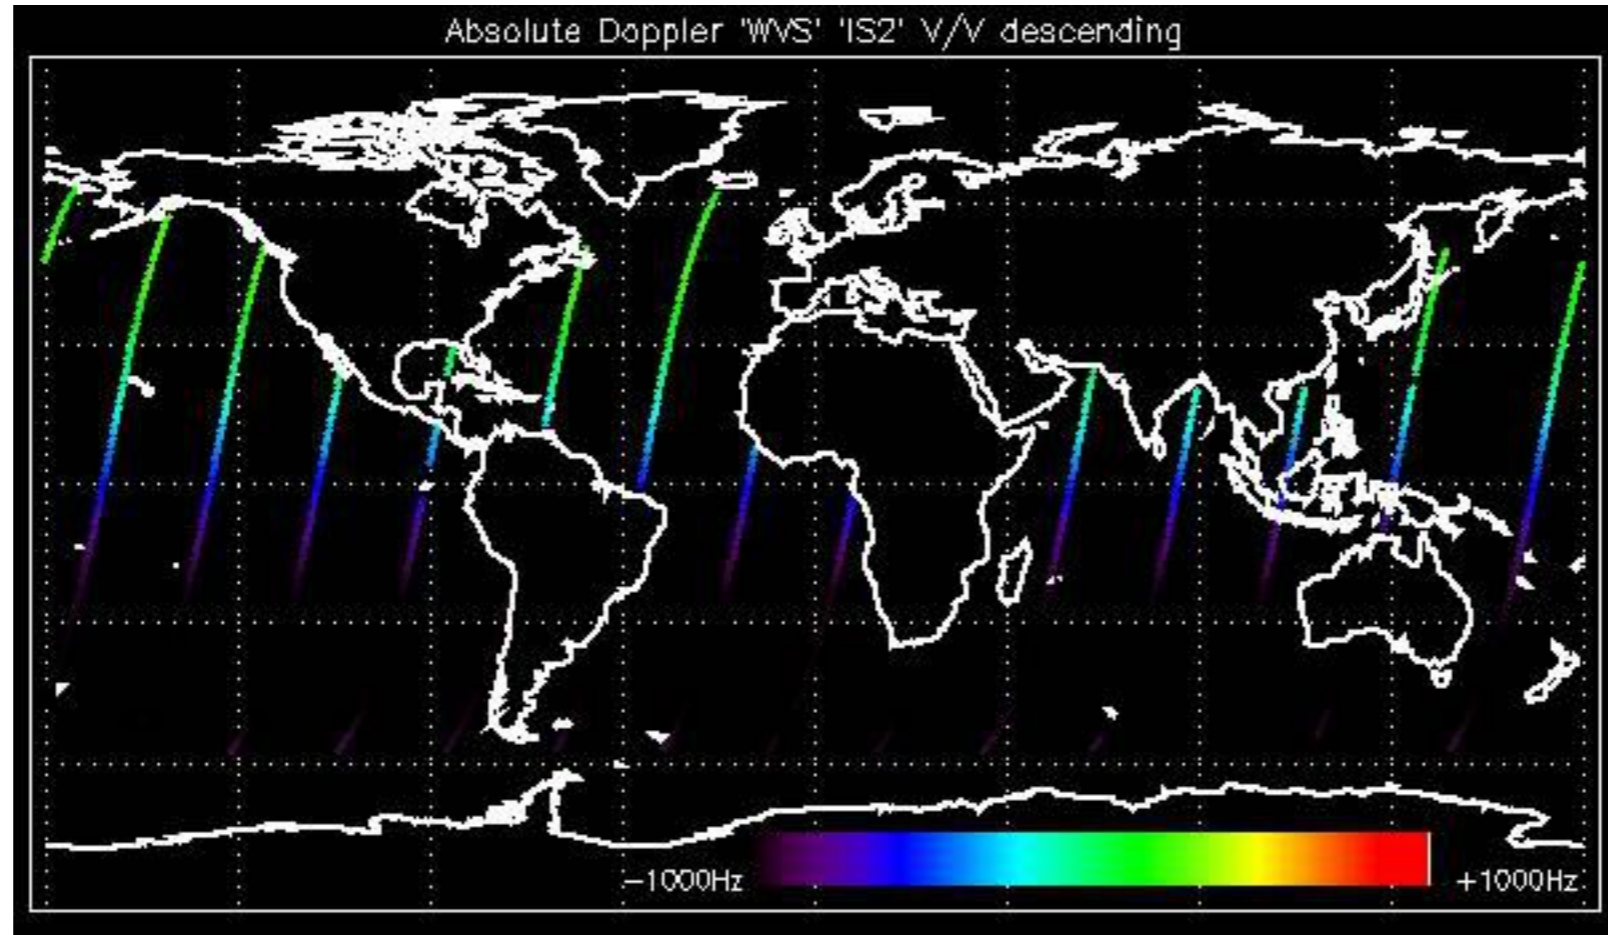

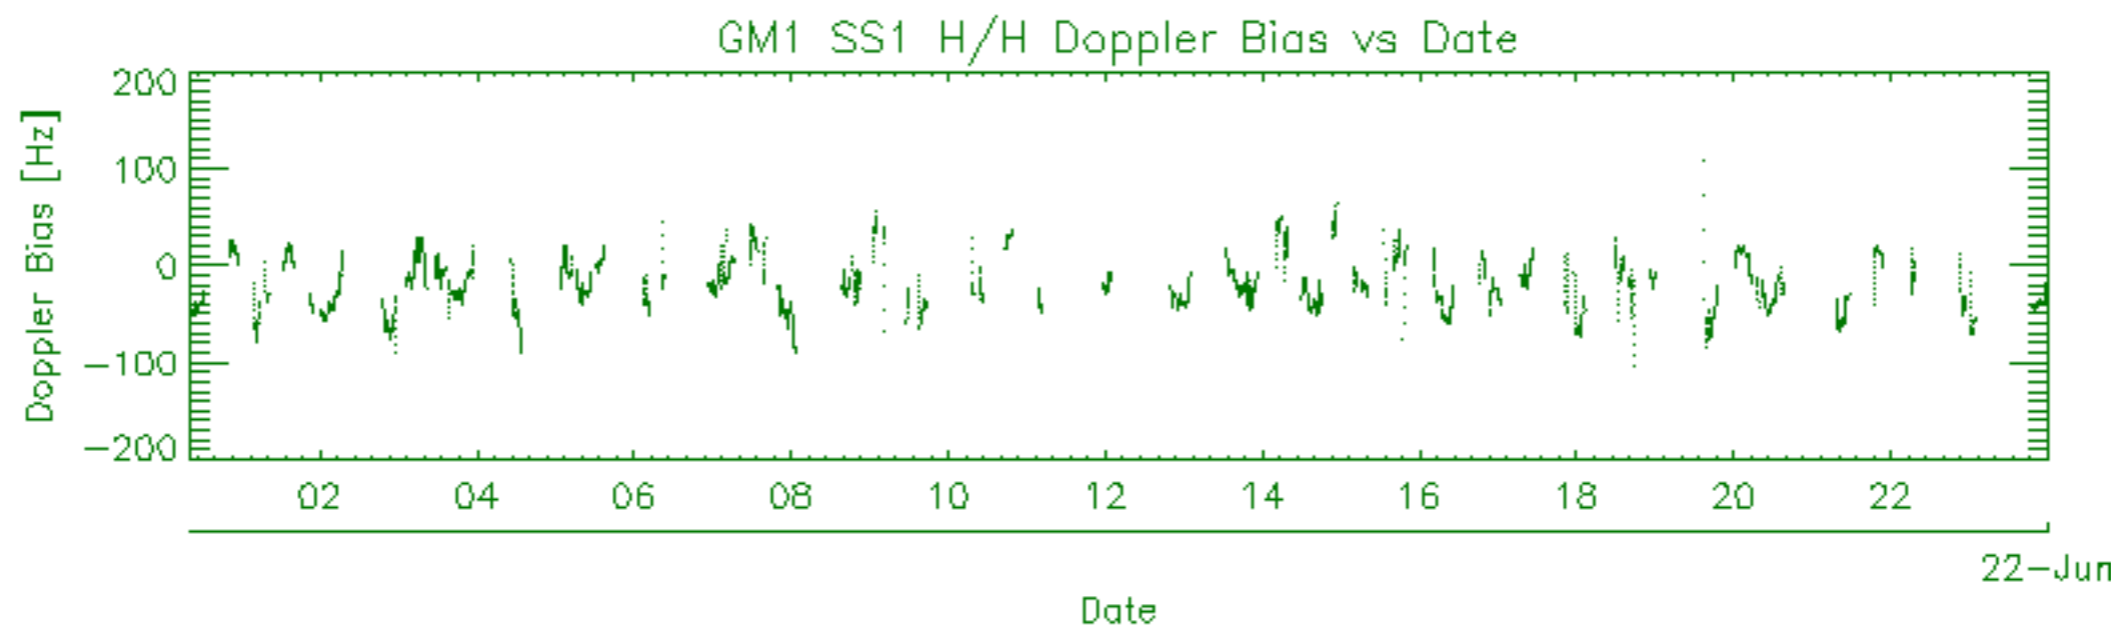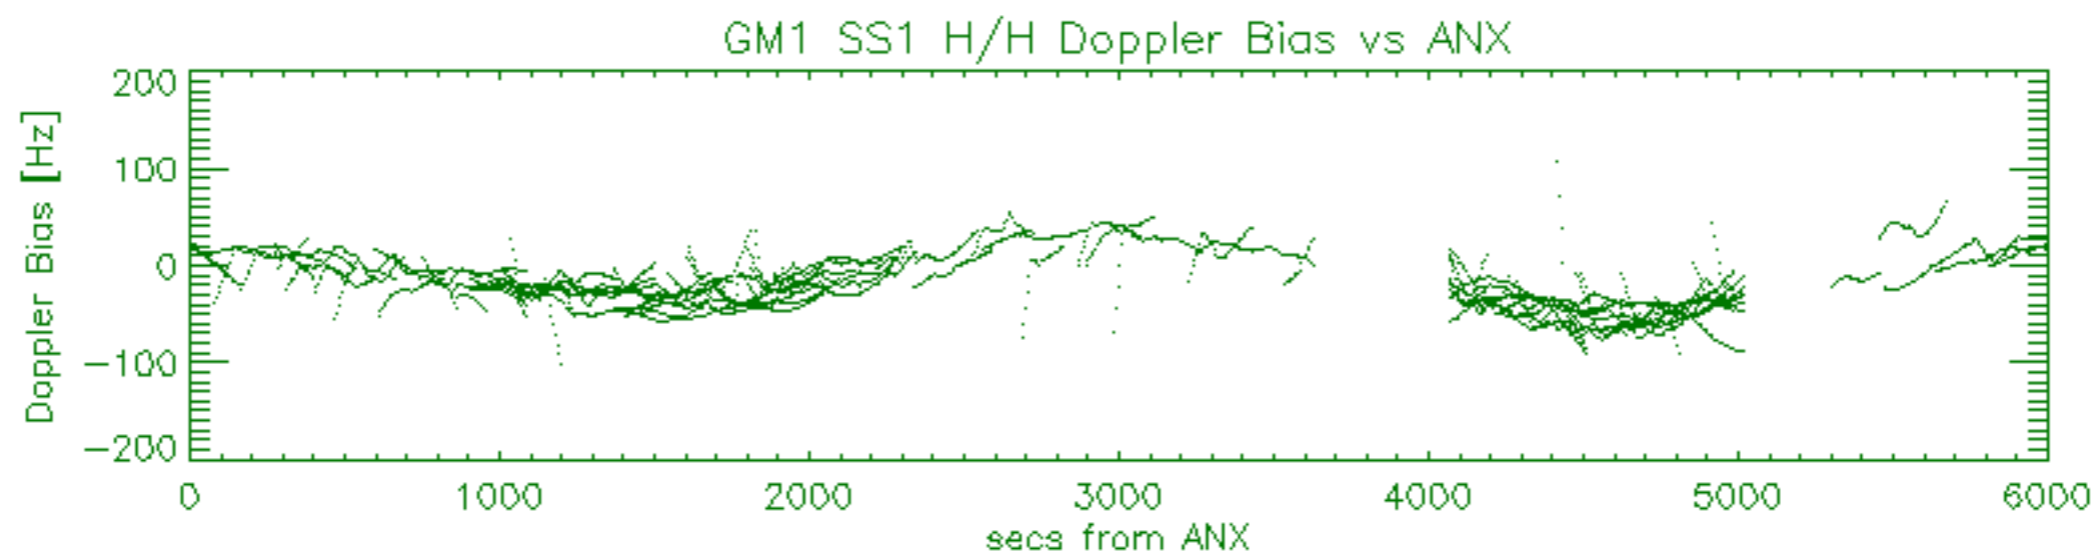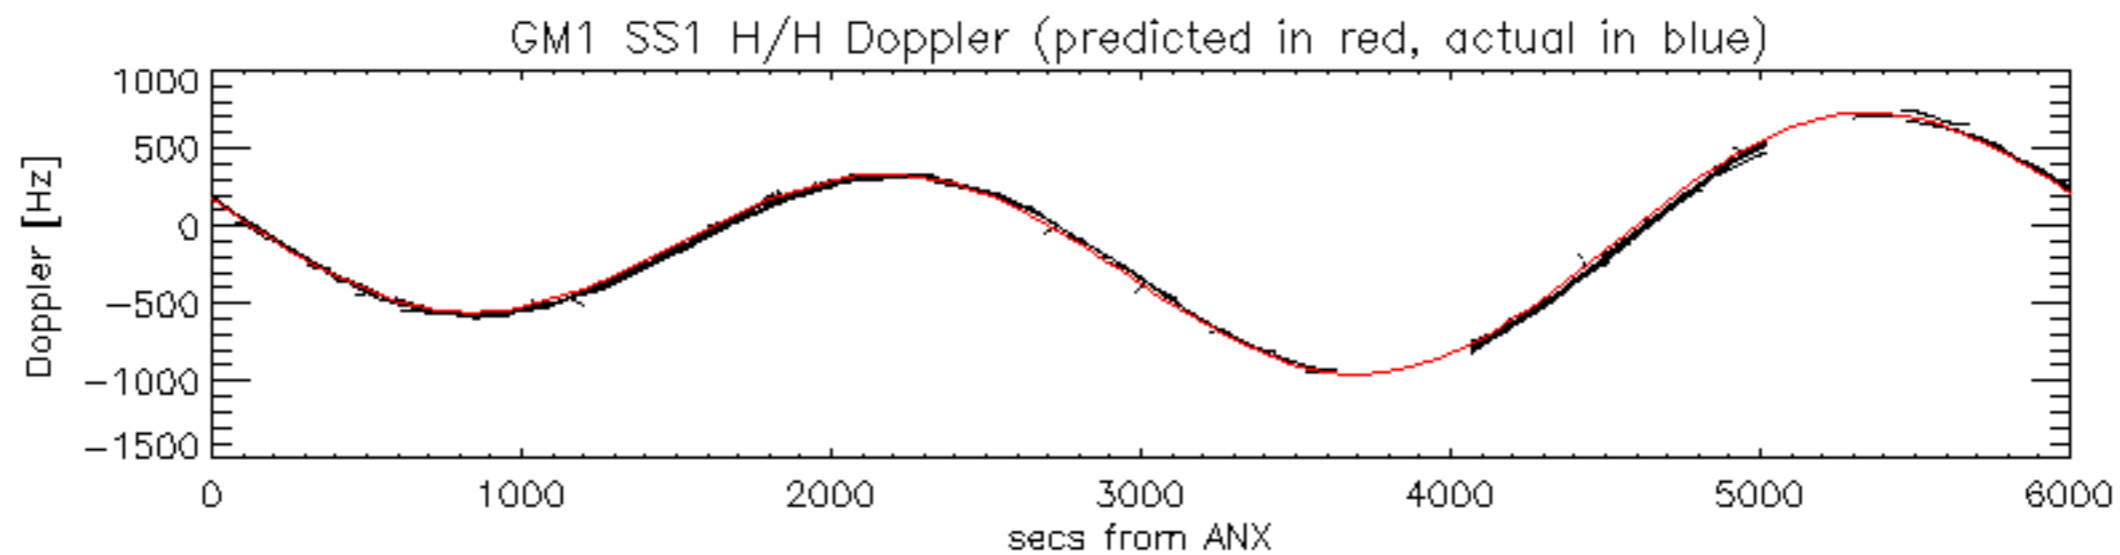


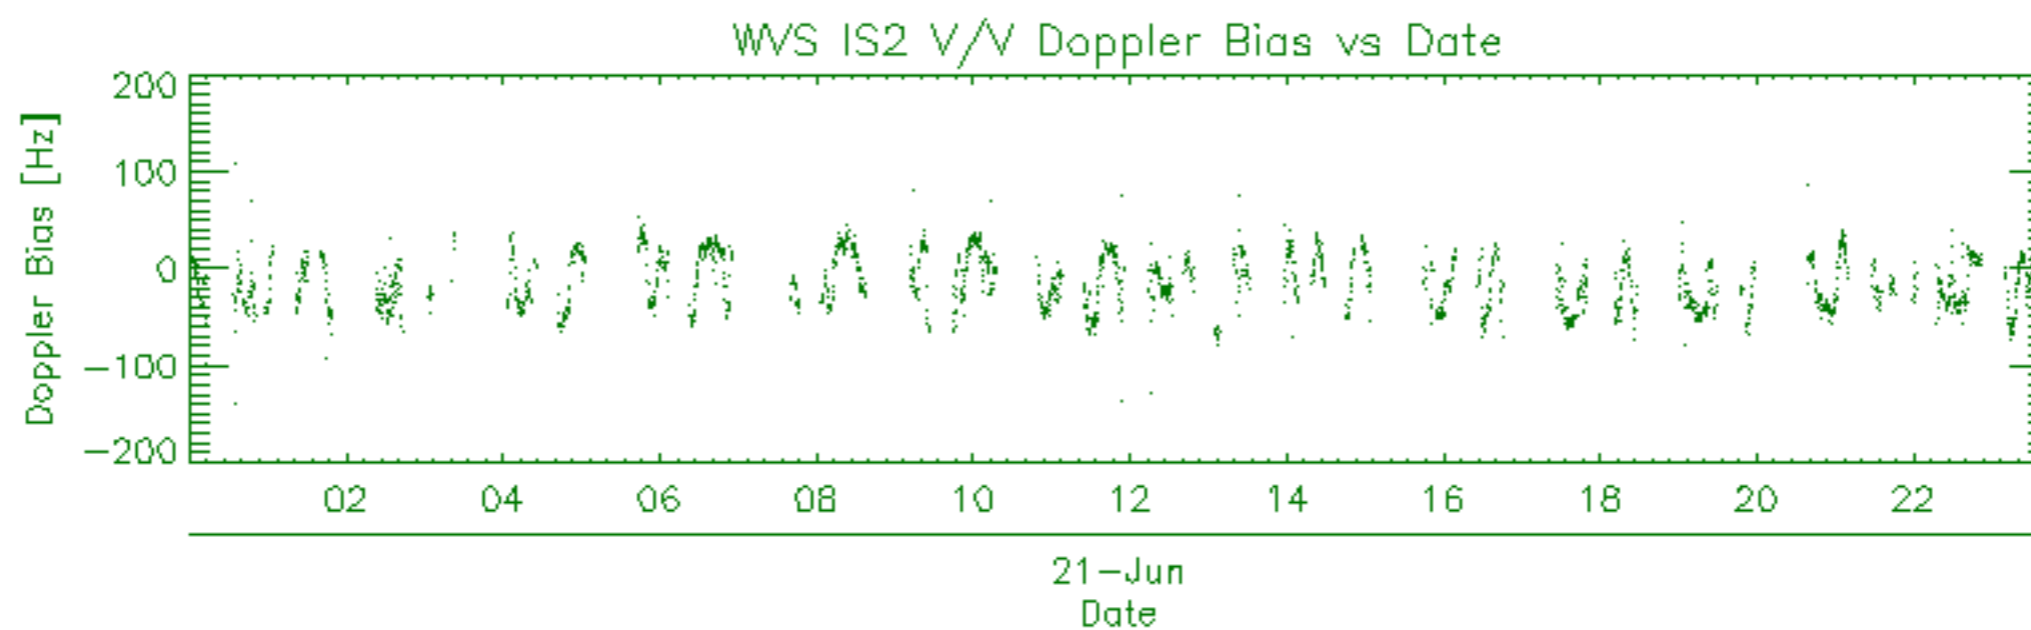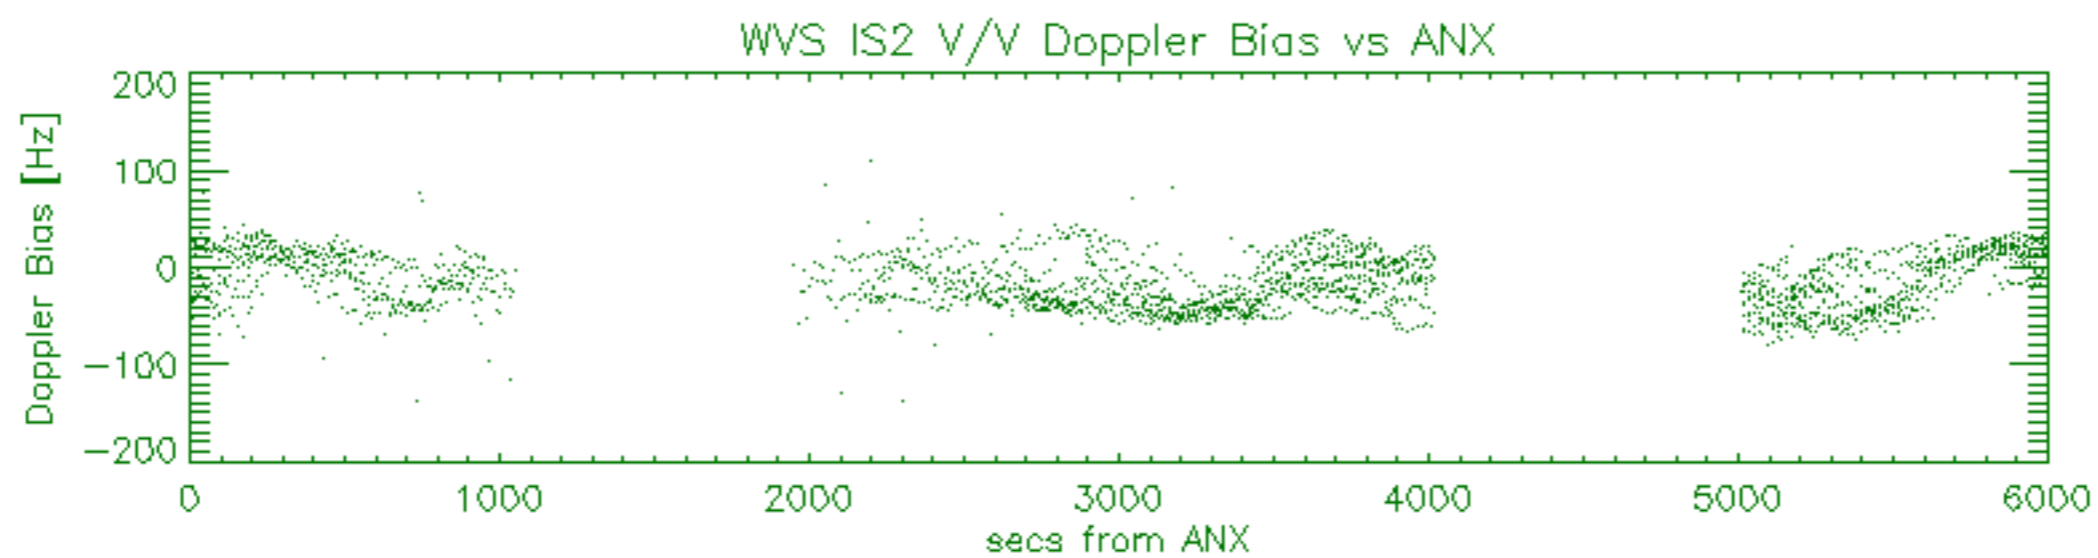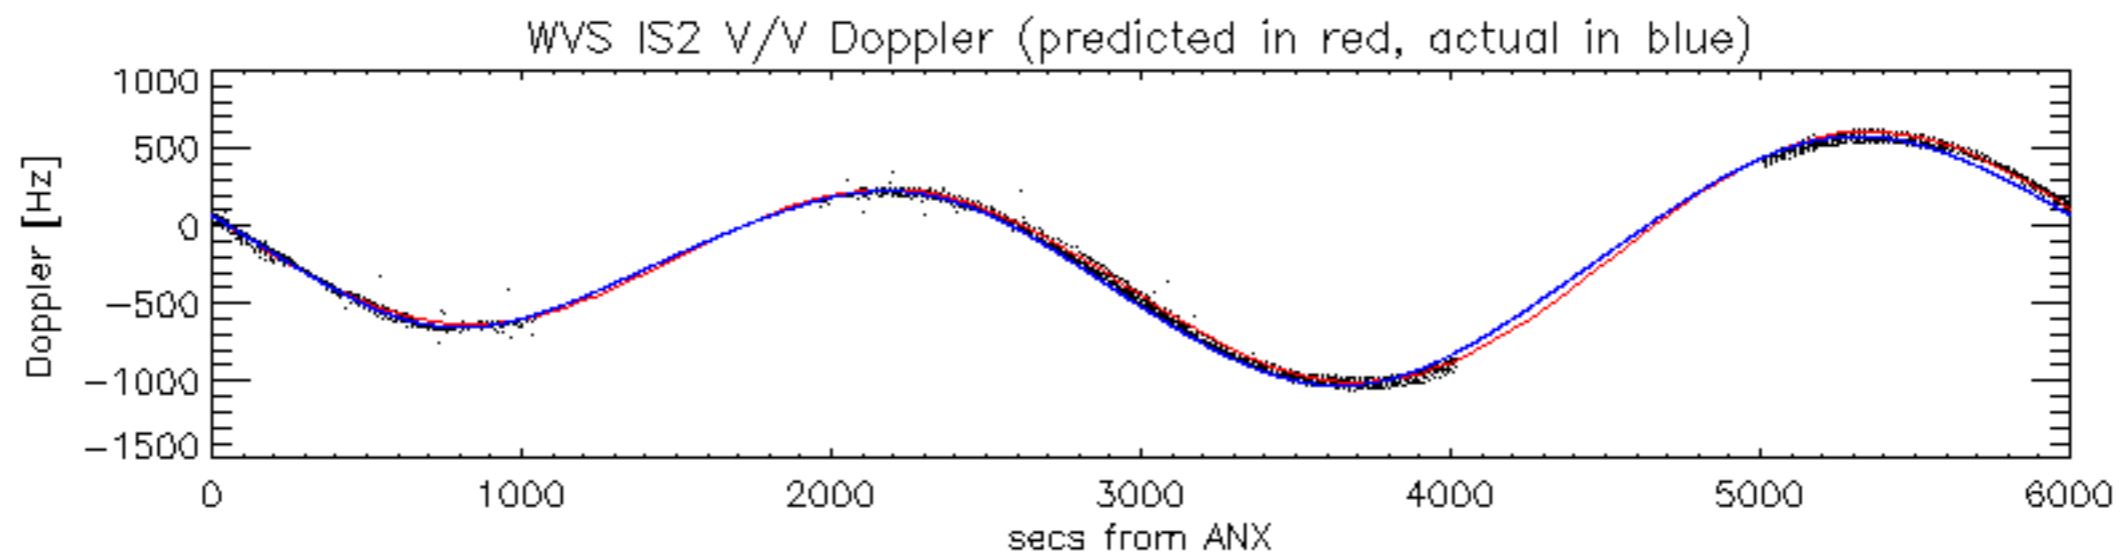





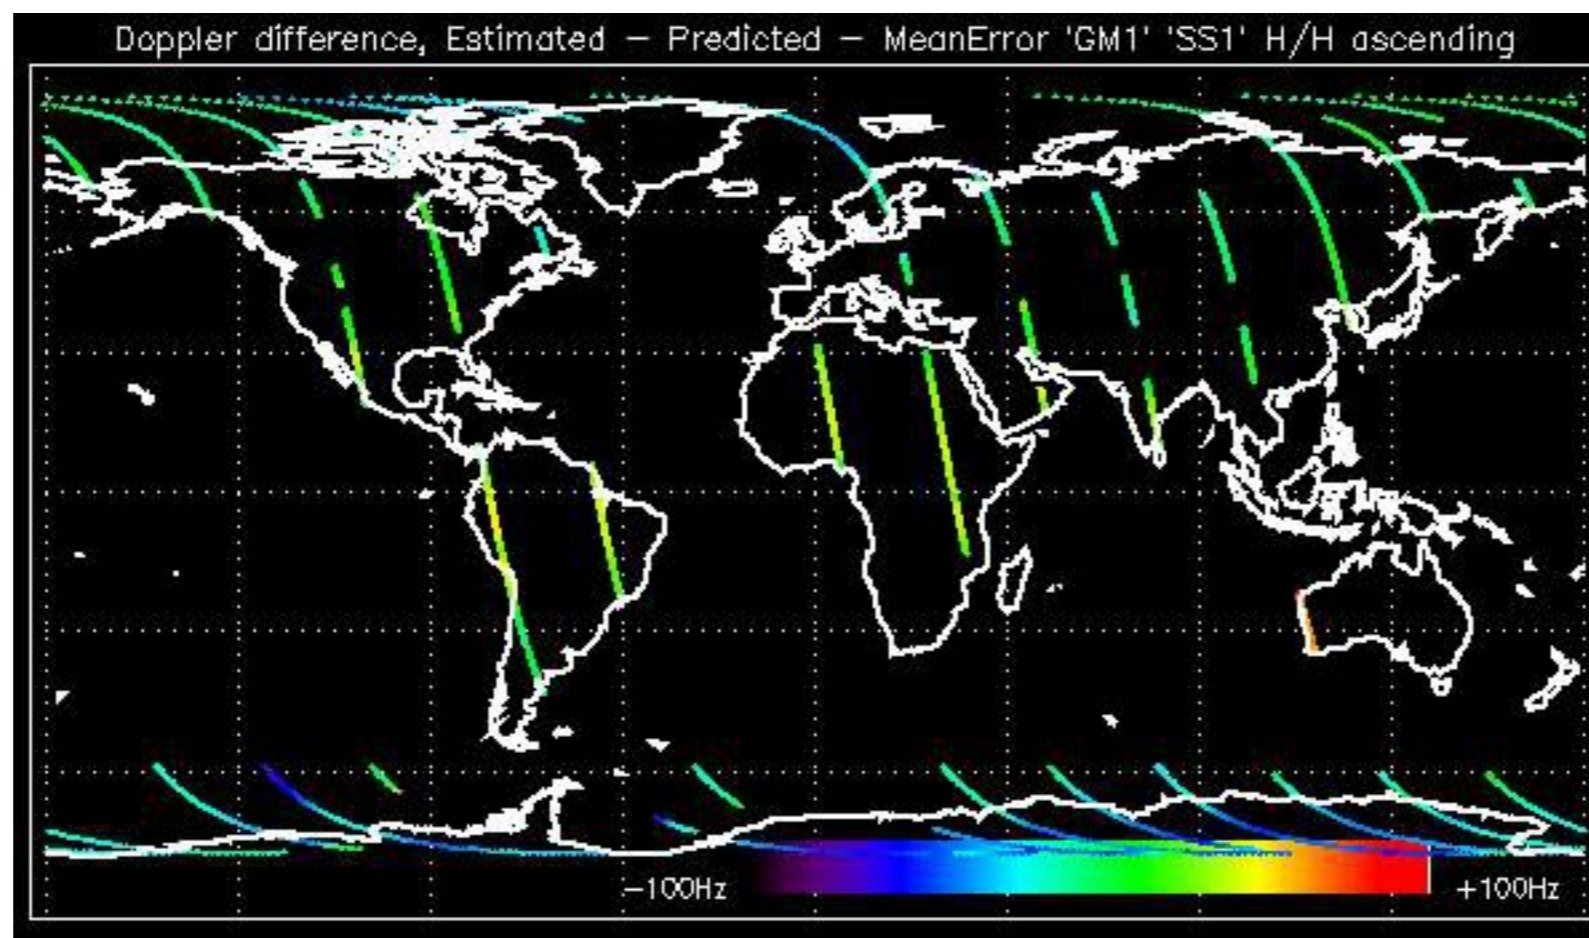


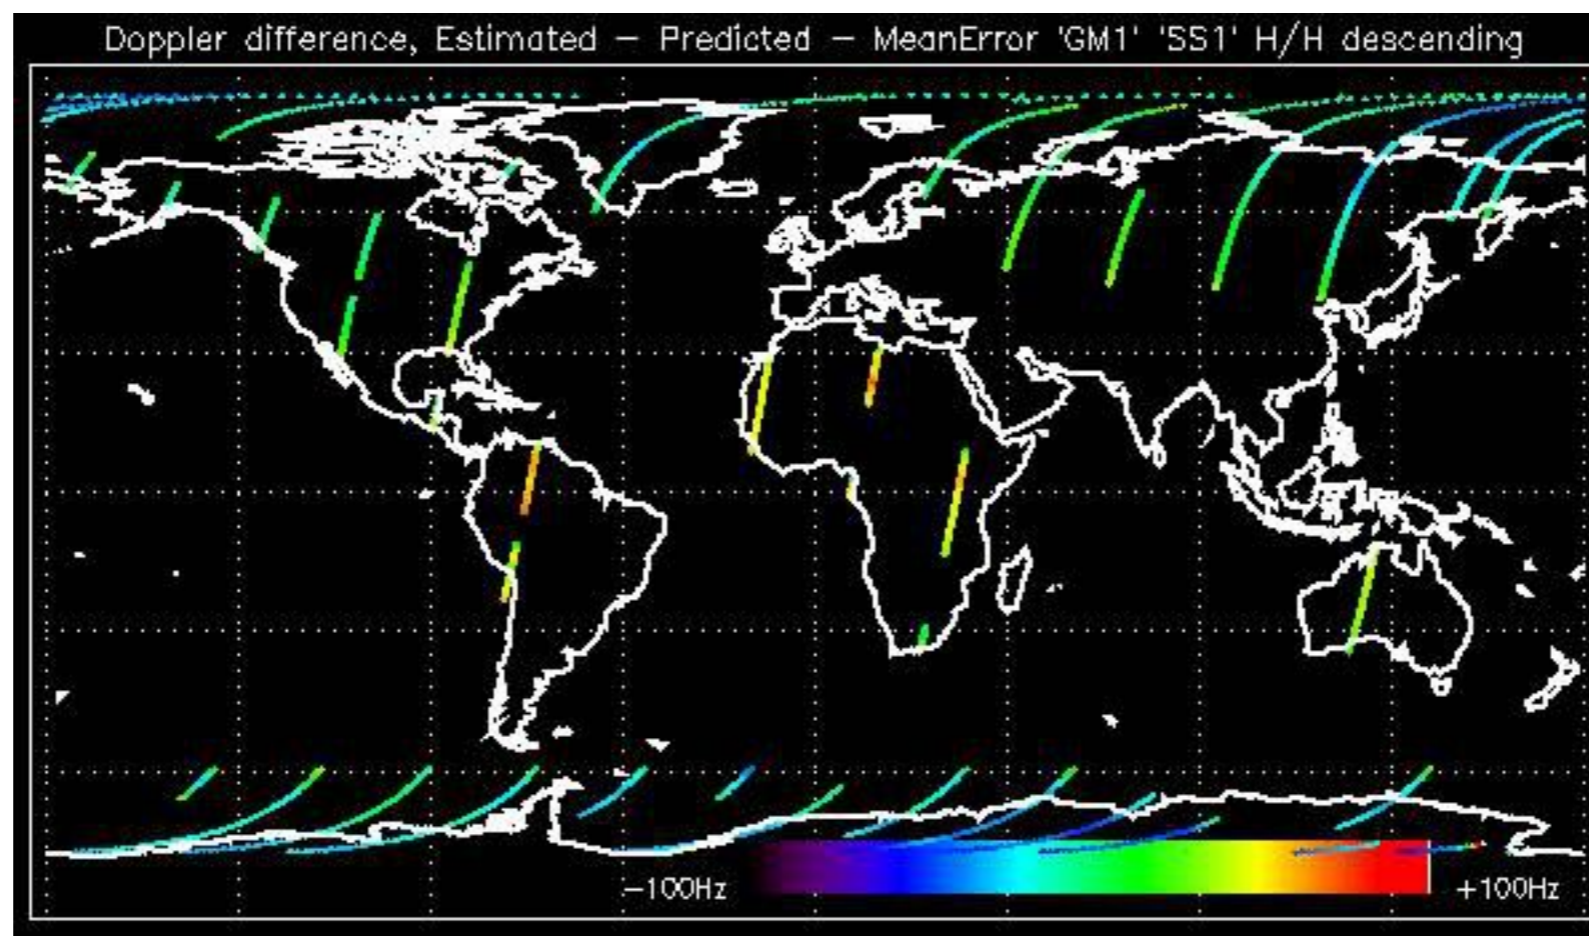




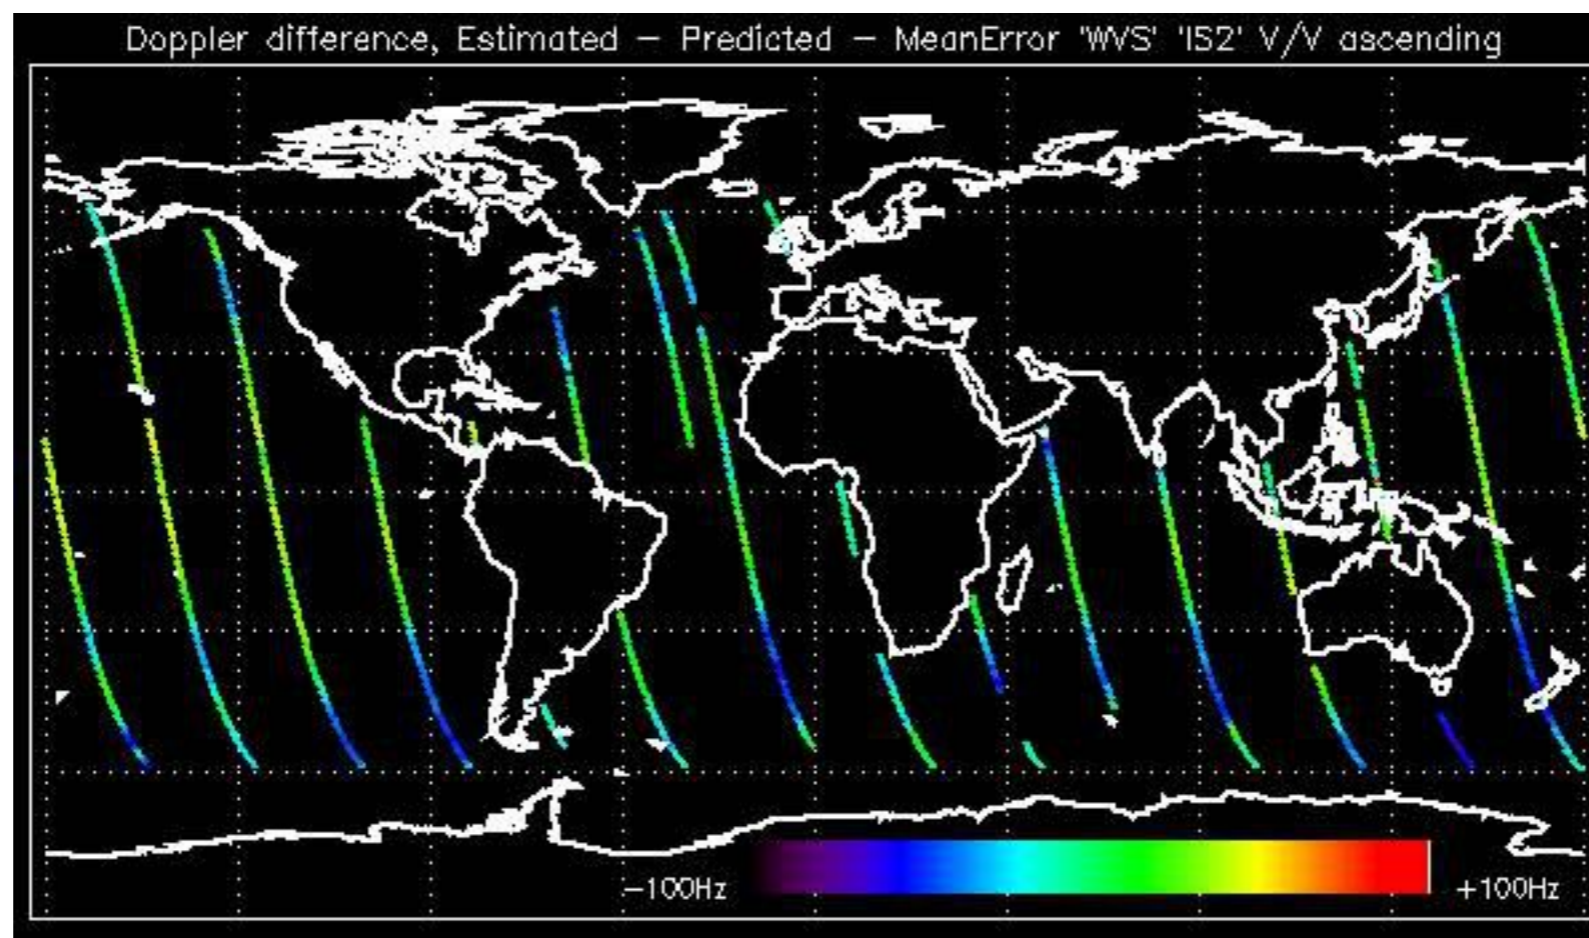

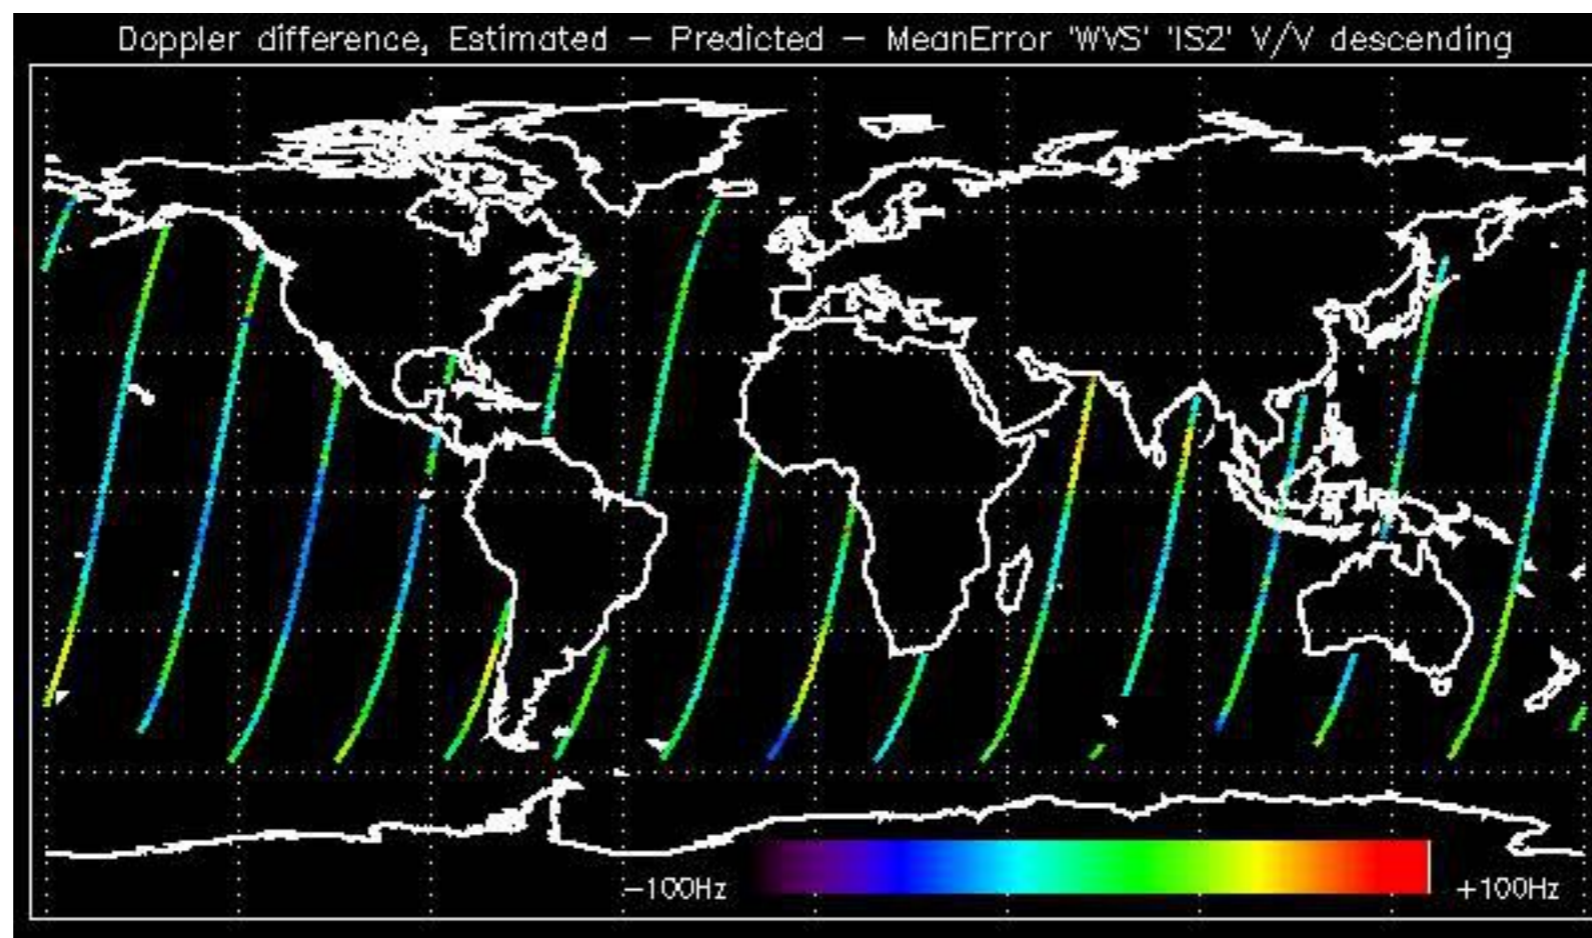

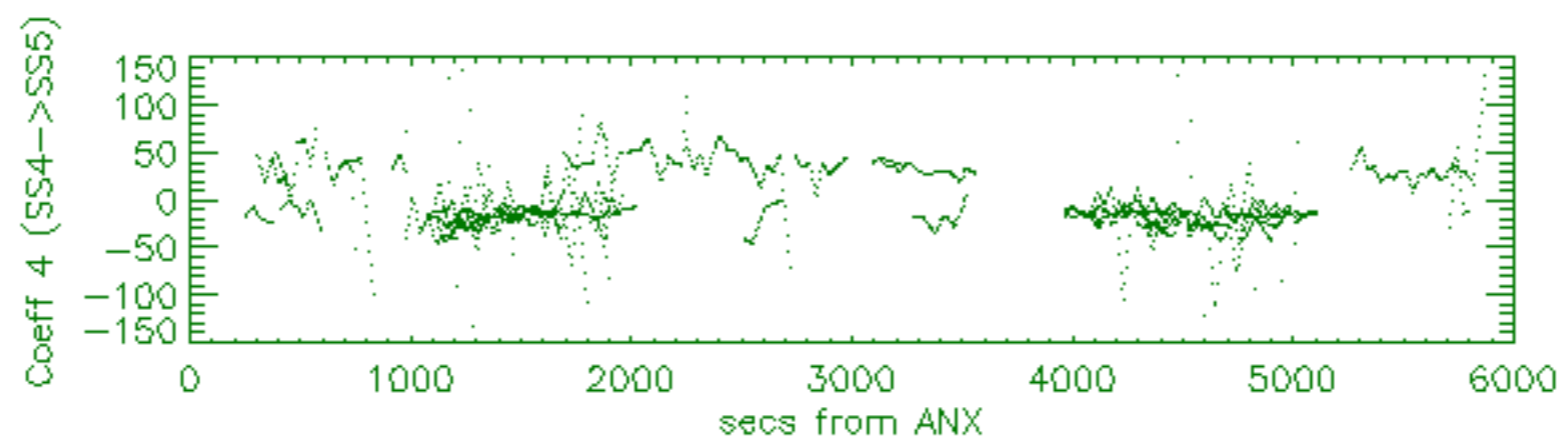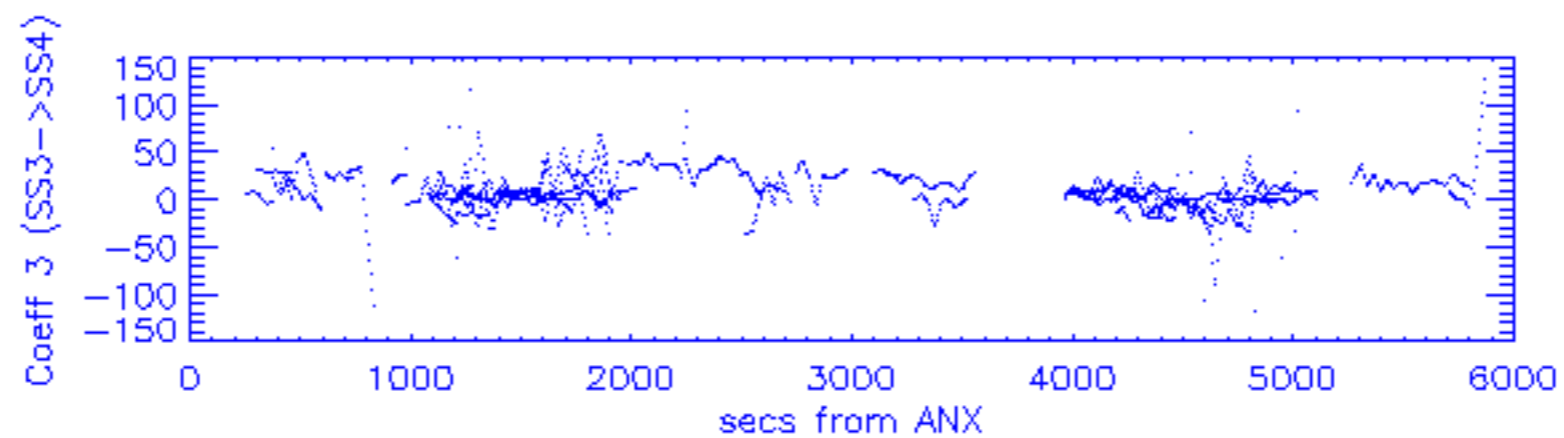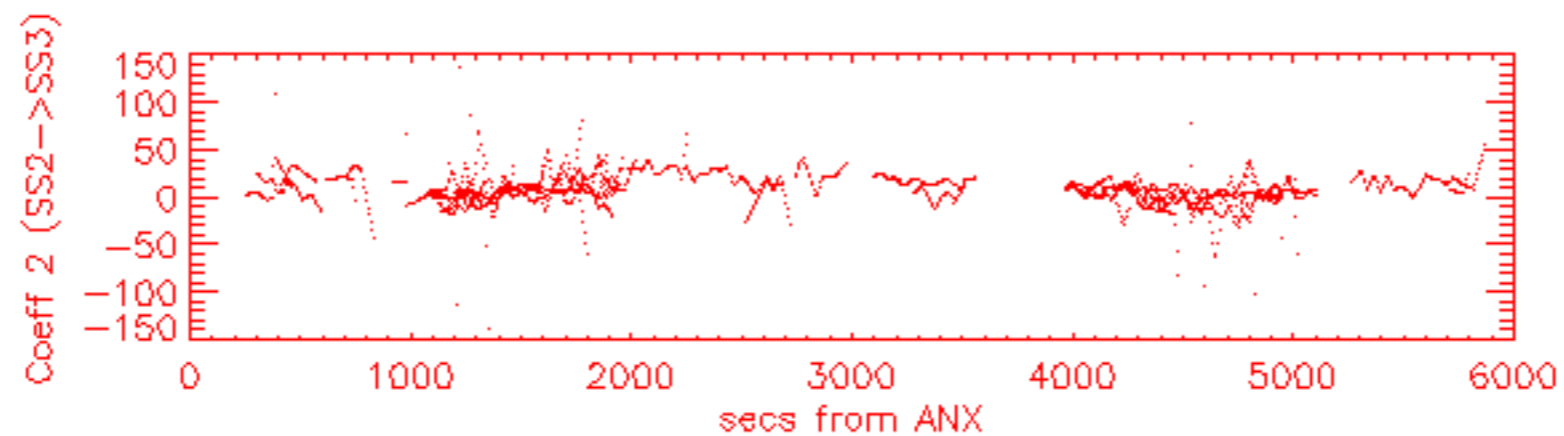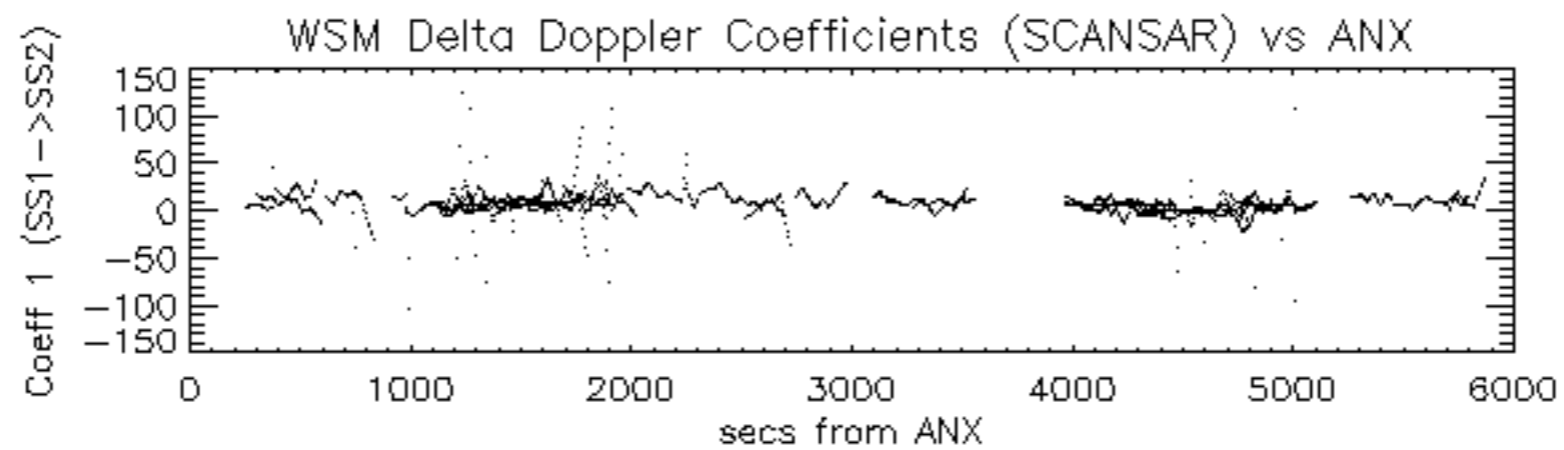

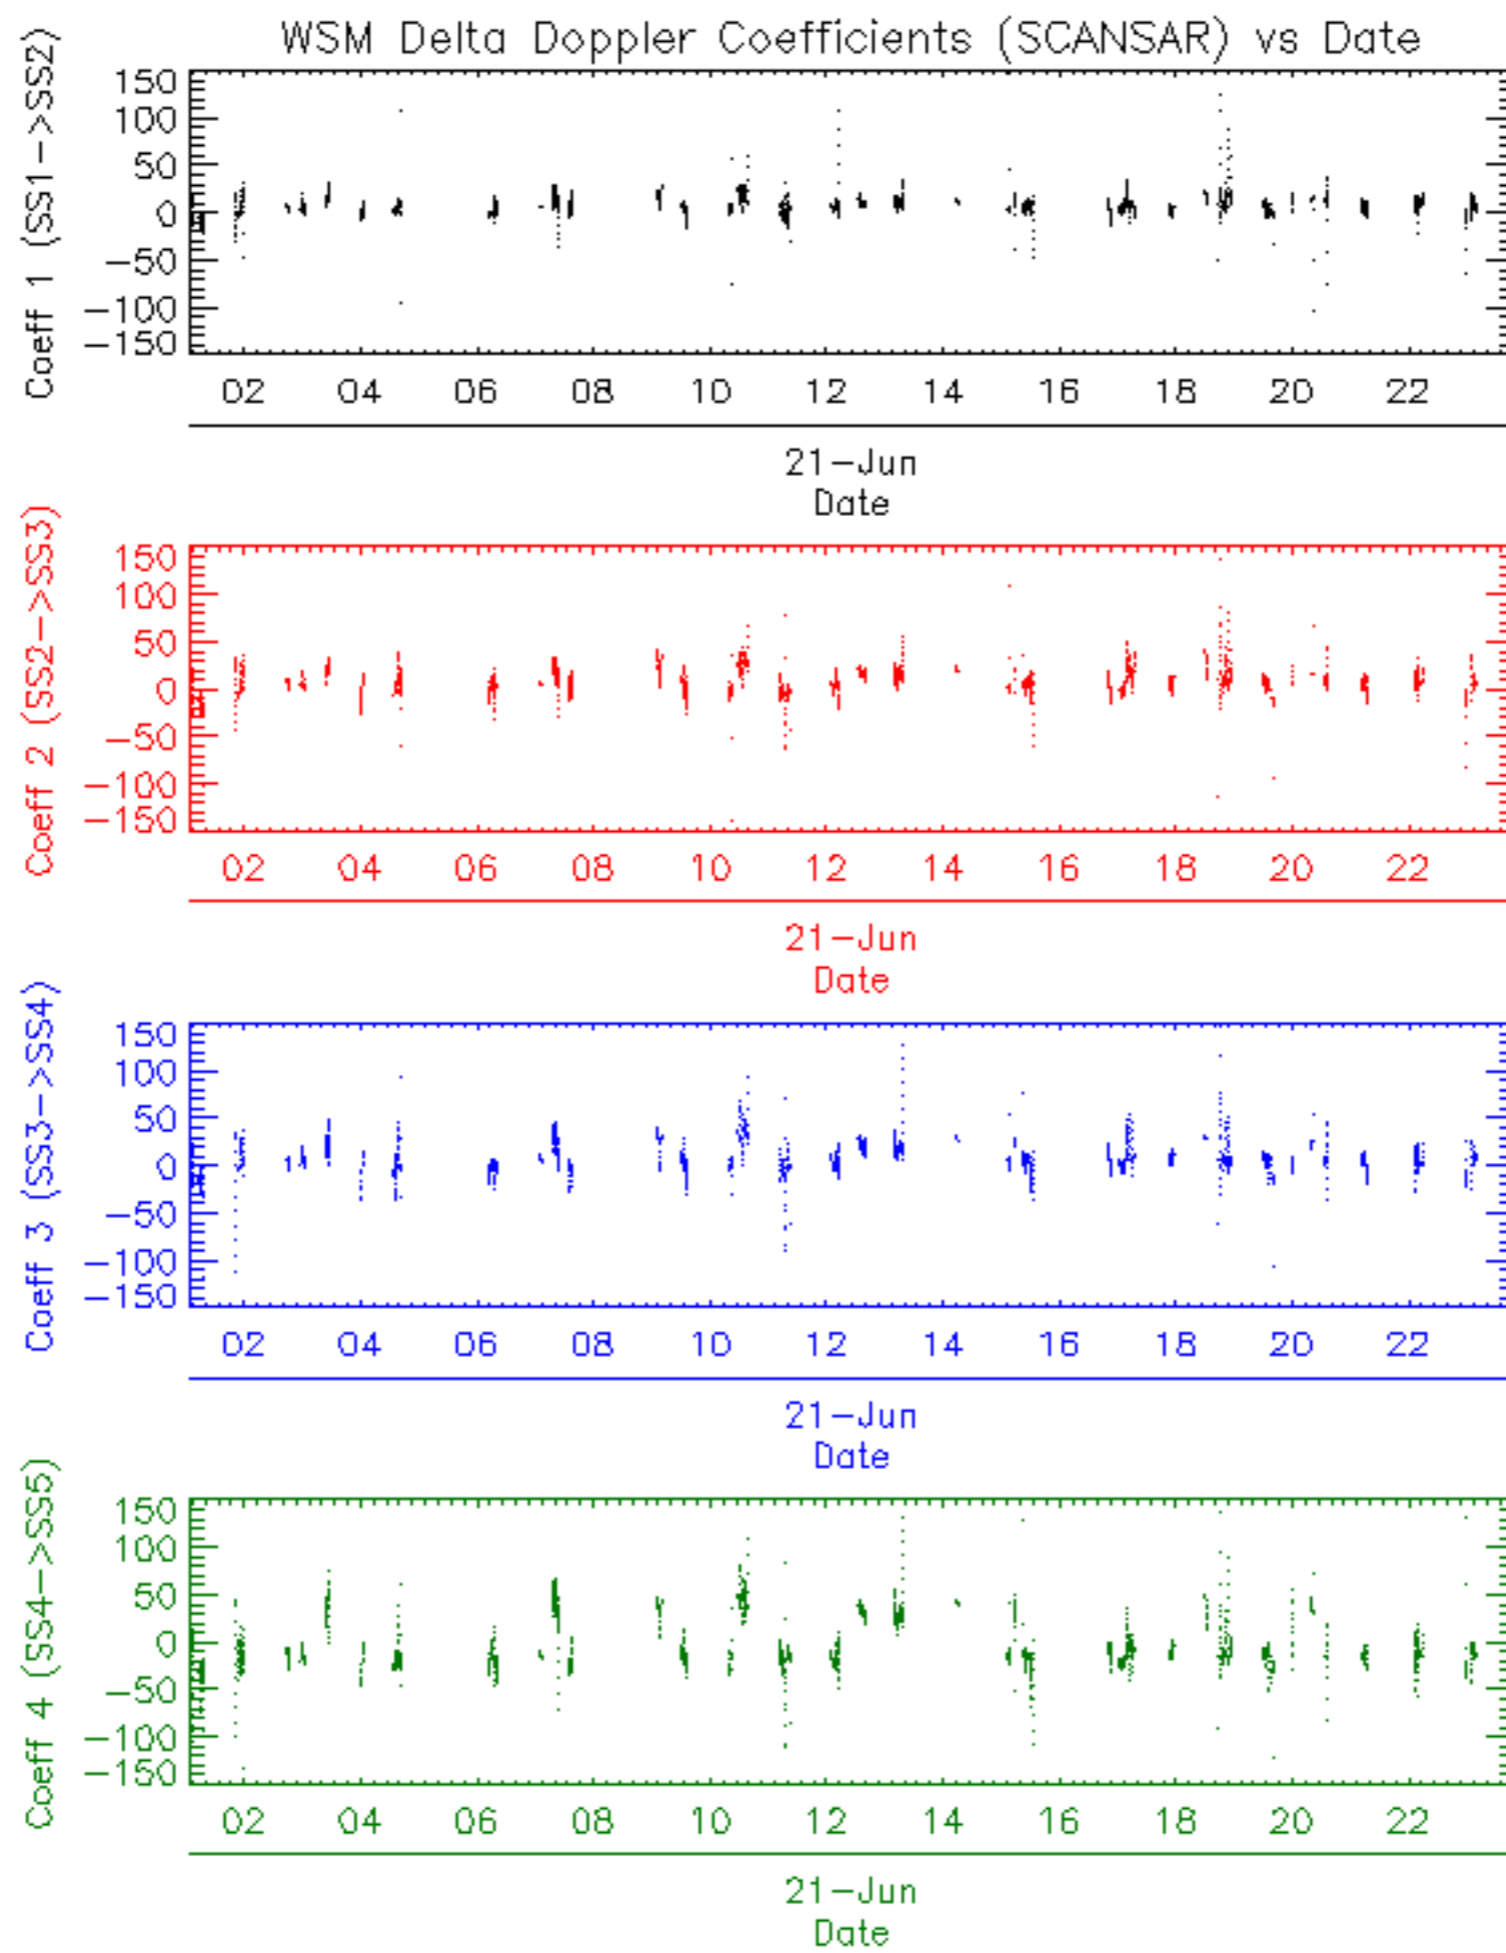






















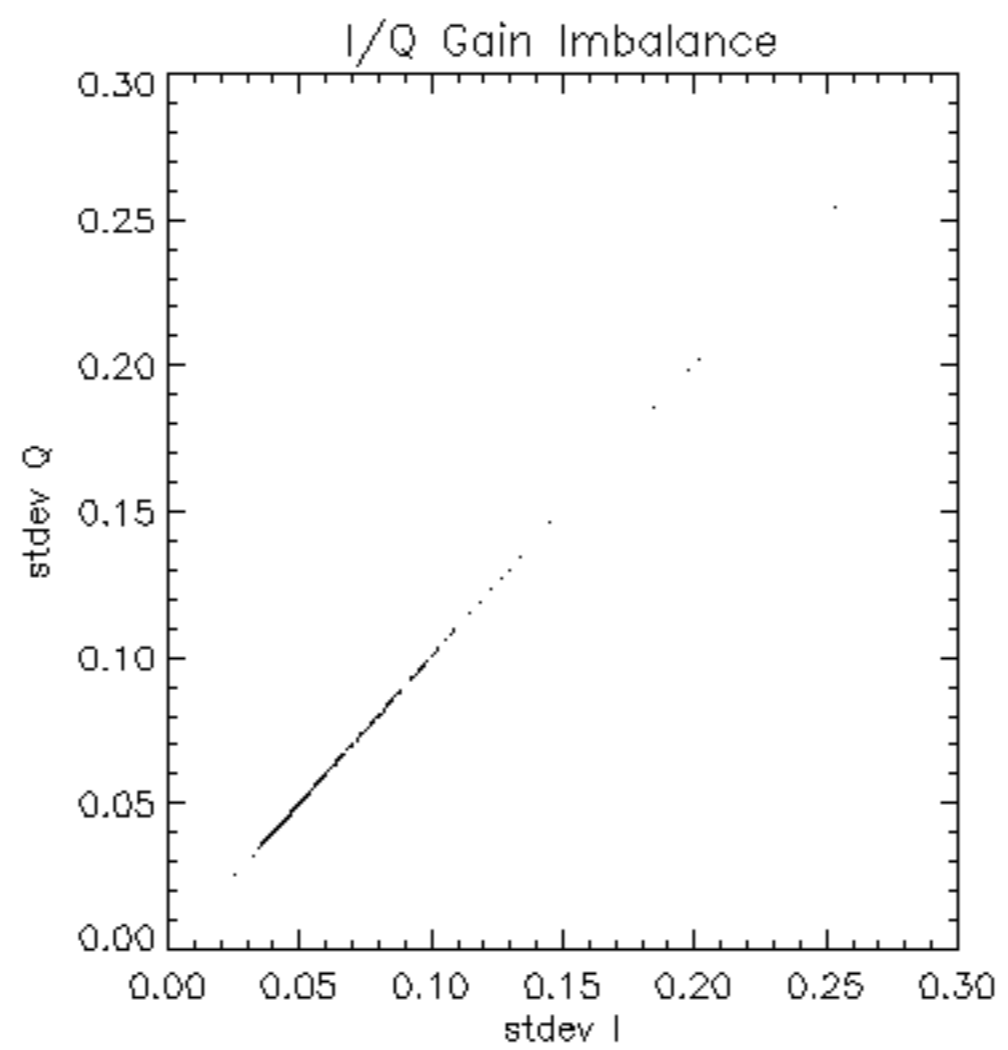


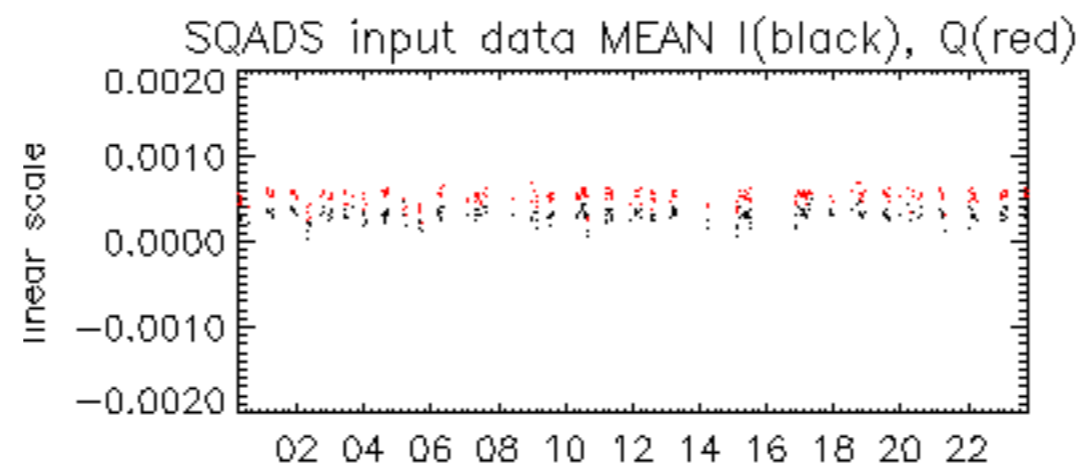




21-Jun

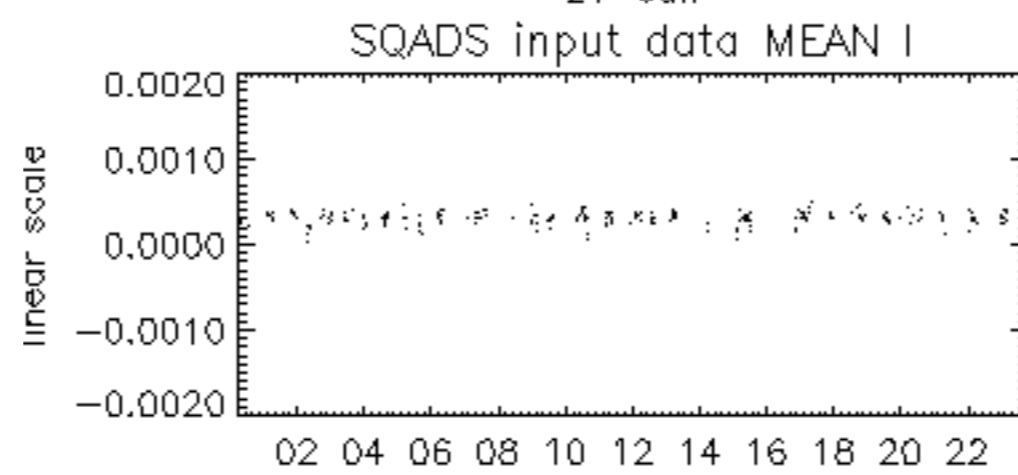


21-Jun

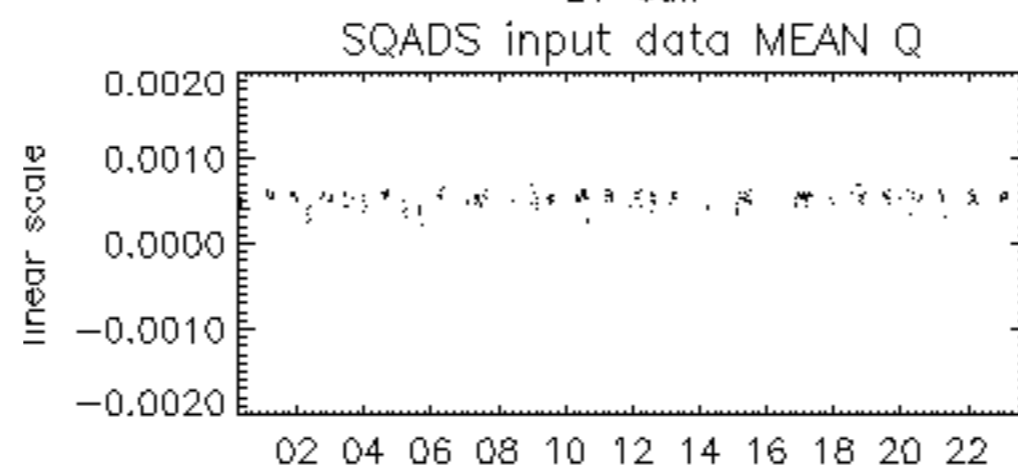


21-Jun

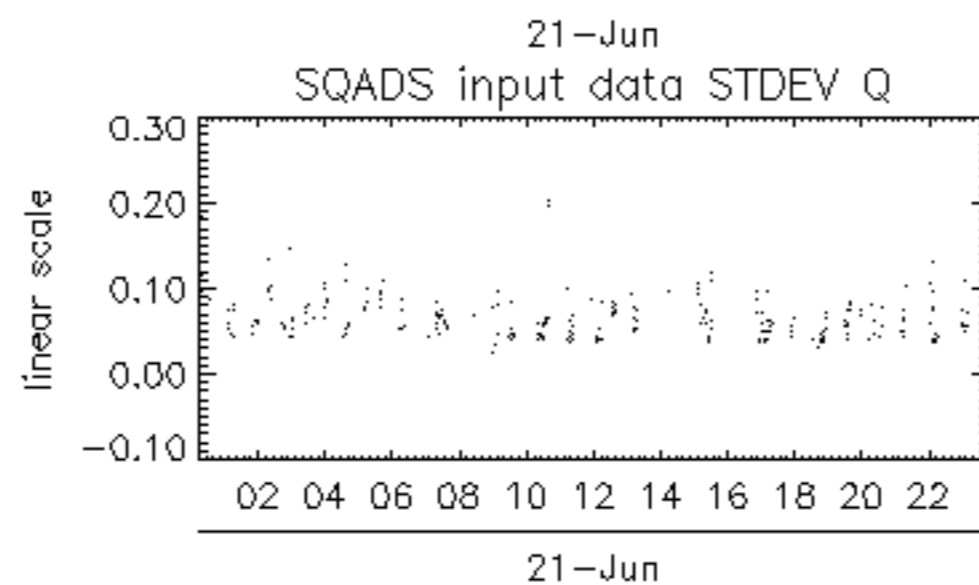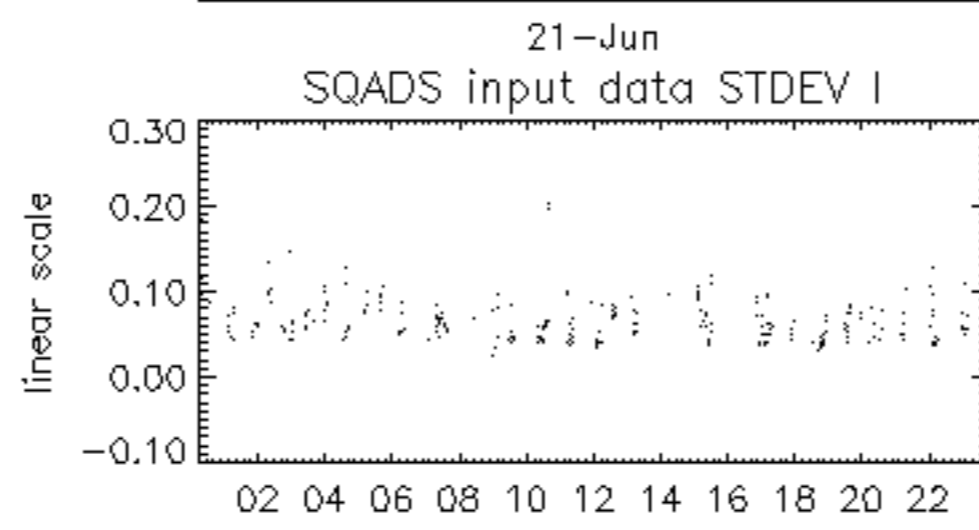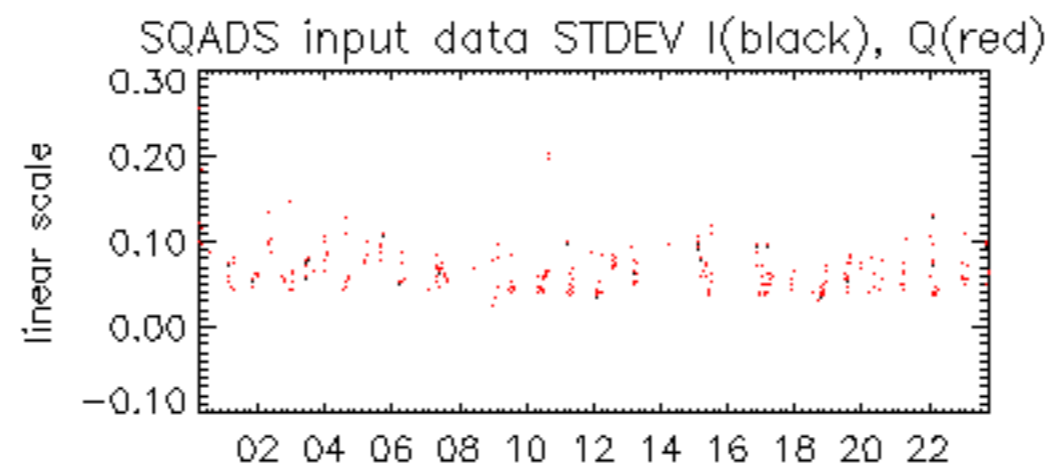


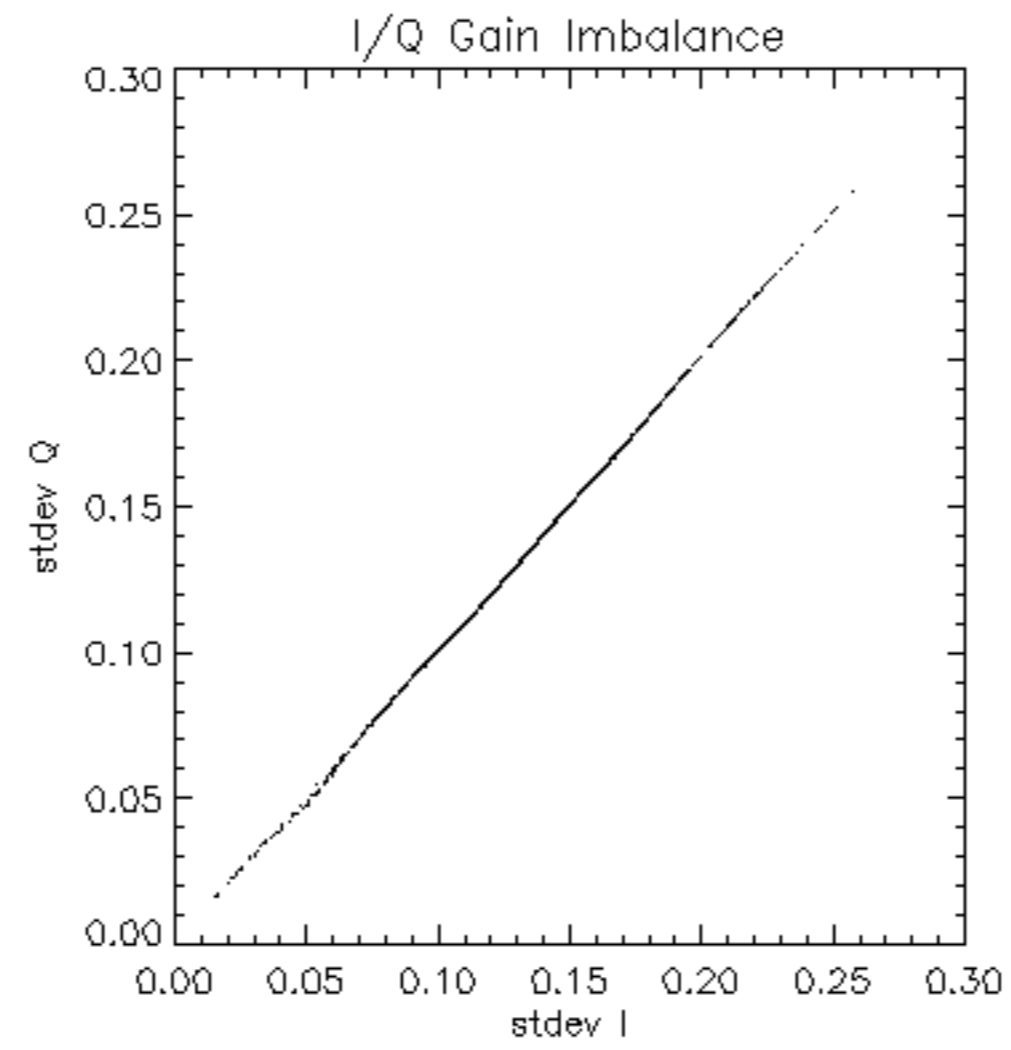




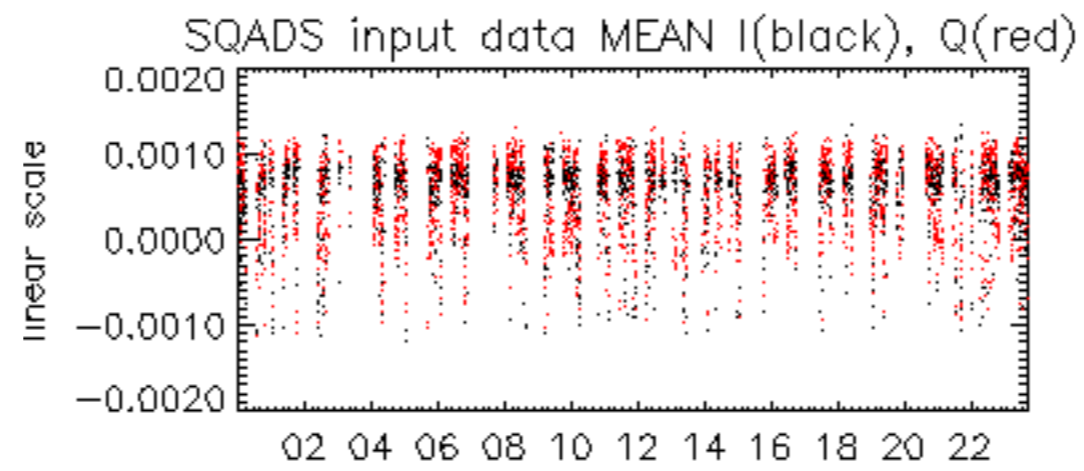


21-Jun

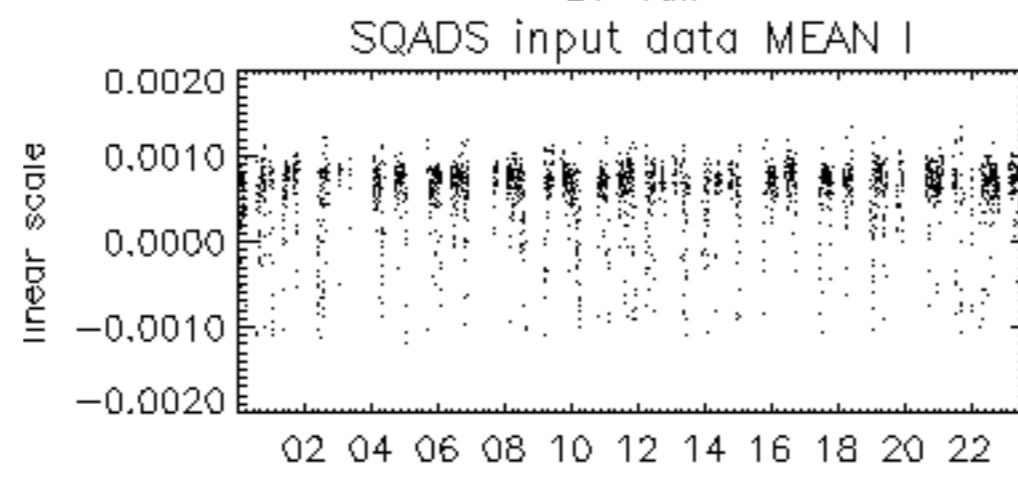


21-Jun

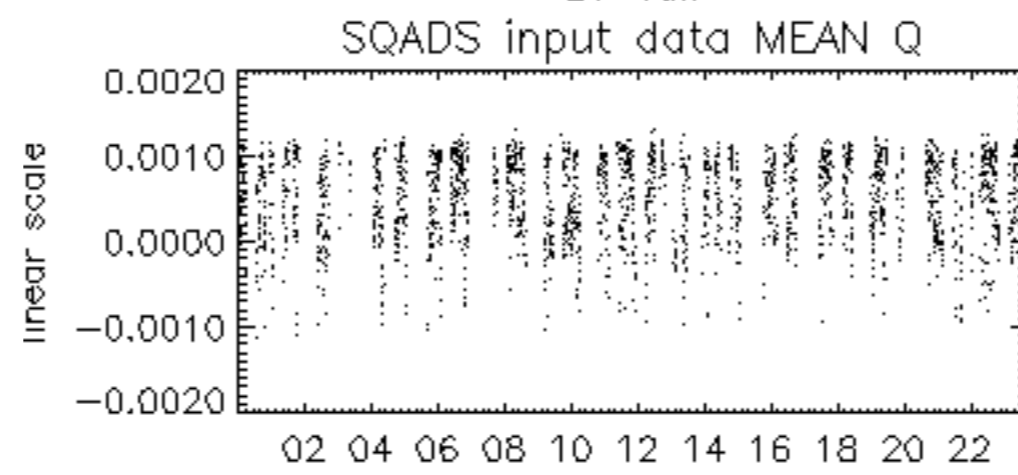


21-Jun

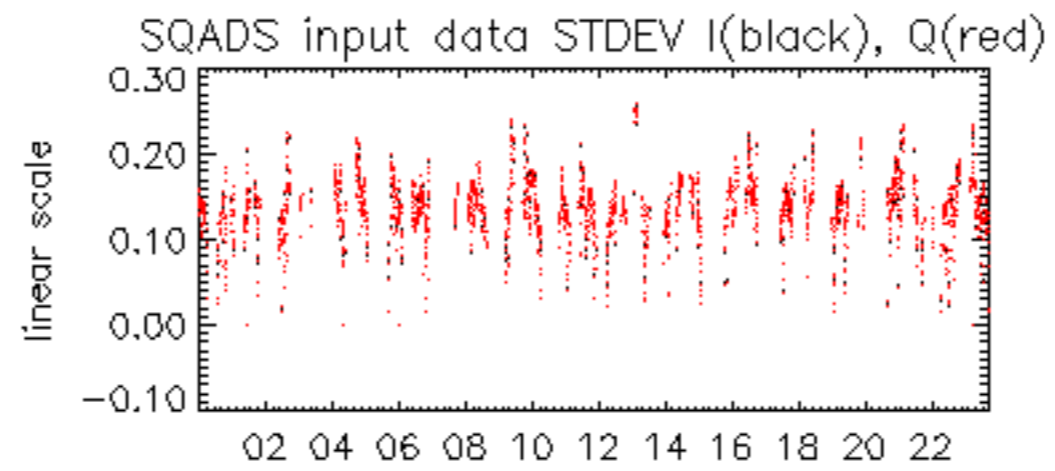

21-Jun

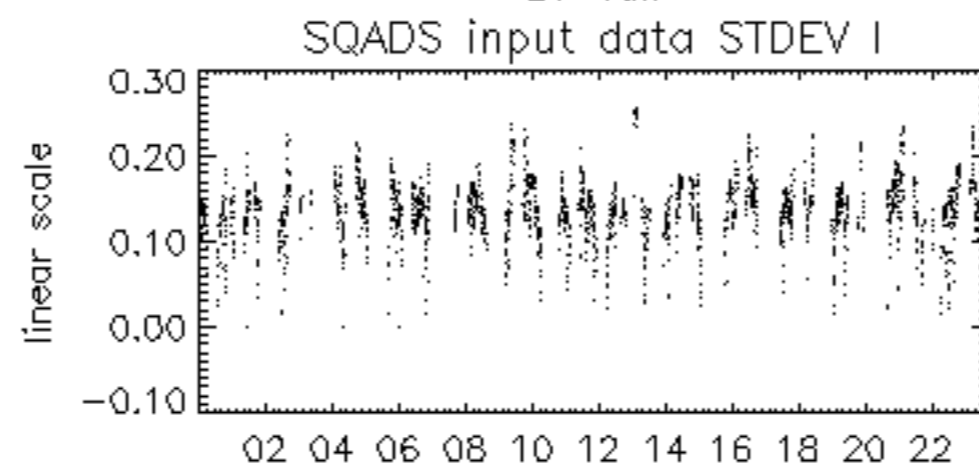

21-Jun

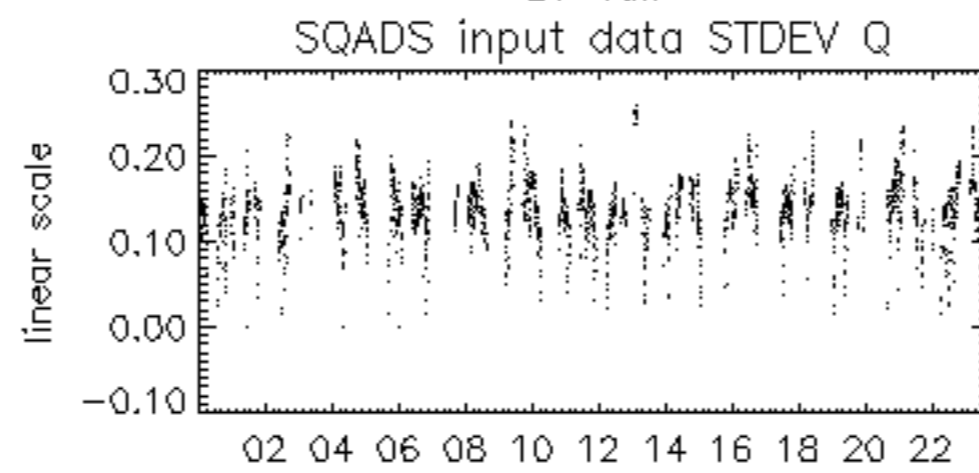

21-Jun

