



# ASAR Daily Report



Analysis from 30-OCT-2007 00:00:00 to 30-OCT-2007 23:59:59. Page generated on 31-OCT-2007 08:35:39.  
View log file: ASAR\_Daily\_Report\_20071031\_0730.log. For any anomalies please contact msantuari@serco.it,mtranfaglia@serco.it,gscarpino@serco.it.

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

## SUMMARY

1. DATA SUMMARY
  - 1.1 Summary tables
  - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
  - 2.1 IECF operational ADFs list
  - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
  - 3.1 V/V polarisation
  - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
  - 4.1 Analysis for WVS IS2 V/V
    - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
    - 4.1.2 All Rows Analysis for WVS IS2 V/V
  - 4.2 Analysis for GM1 SS3 H/H
    - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
    - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
  - 5.1 Analysis for WVS IS2 V/V
    - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
    - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
  - 5.2 Analysis for GM1 SS1 H/H
    - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
    - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
  - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
  - 6.1 Analysis for WSM SS1 H/H
    - 6.1.1 ScaleFactor
  - 6.2 Analysis for WSM SS1 V/V
    - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
  - 7.1 Analysis for WVS
  - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
  - 8.1 Number of Missing Lines
  - 8.2 Number of Gaps

---

## 1 - DATA SUMMARY

### 1.1 - Summary tables

[ BACK TO MENU ]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	6	PDE	WS	H/H	57	PDE	IS2	H/H	7	PDE	IS1	V/V	2	PDE	WS	H/H	45	PDK	2007-10-30 17:33:32	H	320
PDE	IS2	V/V	51	PDK	WS	H/H	42	PDE	IS2	H/V	2	PDE	IS2	H/H	4	PDE	WS	V/V	12				
PDK	IS2	V/V	23					PDE	IS2	V/H	4	PDE	IS2	V/V	22	PDK	WS	H/H	13				
								PDE	IS2	V/V	4	PDE	IS3	V/V	5	PDK	WS	V/V	4				
								PDE	IS7	H/H	1	PDE	IS4	H/H	1								
								PDK	IS1	H/V	2	PDE	IS5	V/V	2								
												PDE	IS6	V/V	5								
												PDE	IS7	H/H	2								
												PDK	IS1	V/V	2								
												PDK	IS2	H/H	1								
												PDK	IS2	V/V	13								

## 1.2 - Lists of products used

[ [BACK TO MENU](#) ]

[[TXT](#)] [[XLS](#)] [List\\_WVS\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_GM1\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_APM\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_IMM\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_WSM\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_MS\\_products\\_used](#)

## 2 - AUXILIARY FILES ANALYSIS

### 2.1 - IECF operational ADFs list

[ [BACK TO MENU](#) ]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20070410_140202_20070204_165113_20071231_000000
ASA_INS_AXVIEC20070306_164819_20070307_060000_20071231_000000
ASA_XCH_AXVIEC20051219_162547_20020301_000000_20081231_000000
ASA_XCA_AXVIEC20070517_153558_20070204_165113_20071231_000000

### 2.2 - Products with wrong ADFs





[ [BACK TO MENU](#) ]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0

[[TXT](#)] [[XLS](#)] [Check\\_ADFs\\_WVS](#)  
 [[TXT](#)] [[XLS](#)] [Check\\_ADFs\\_GM1](#)

### 3 - MODULE STEPPING PRODUCTS ANALYSIS



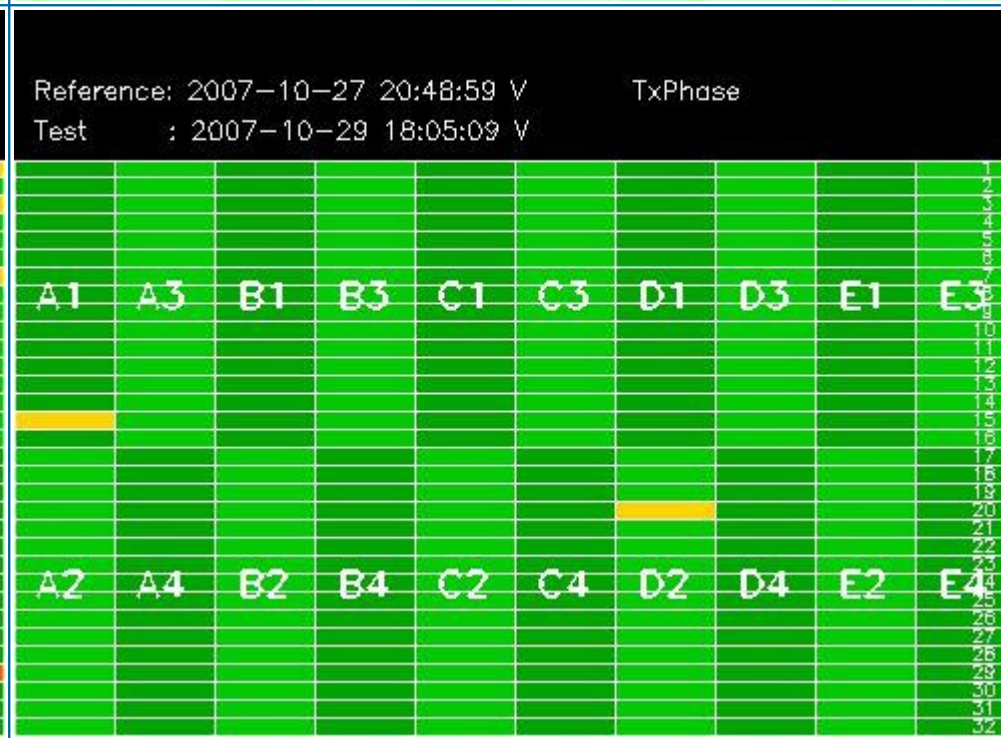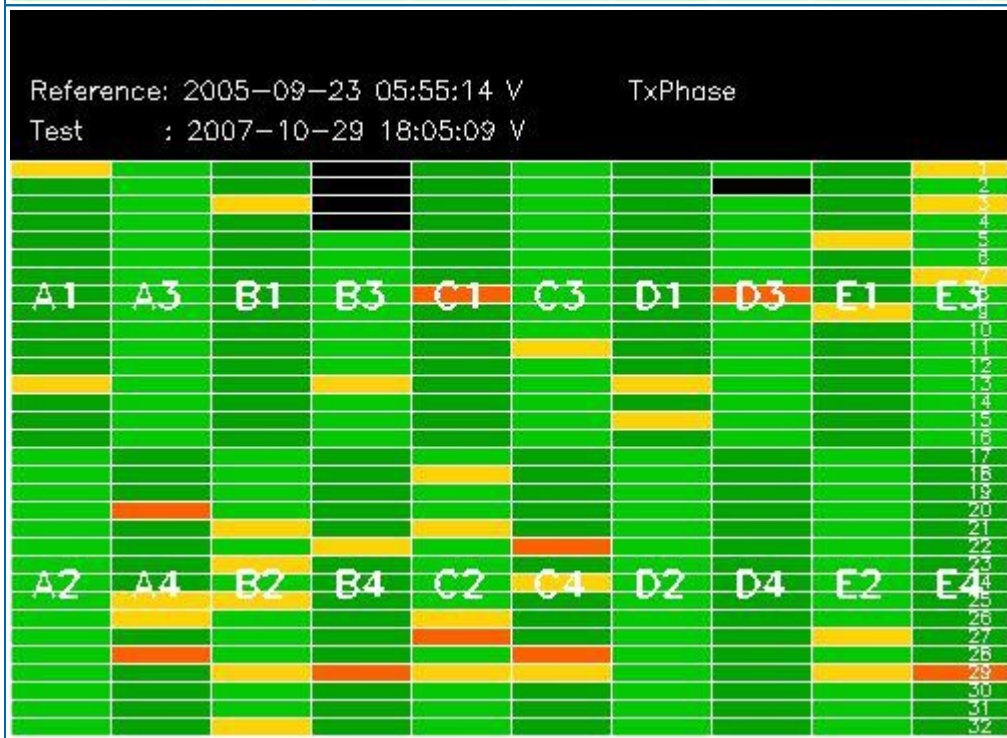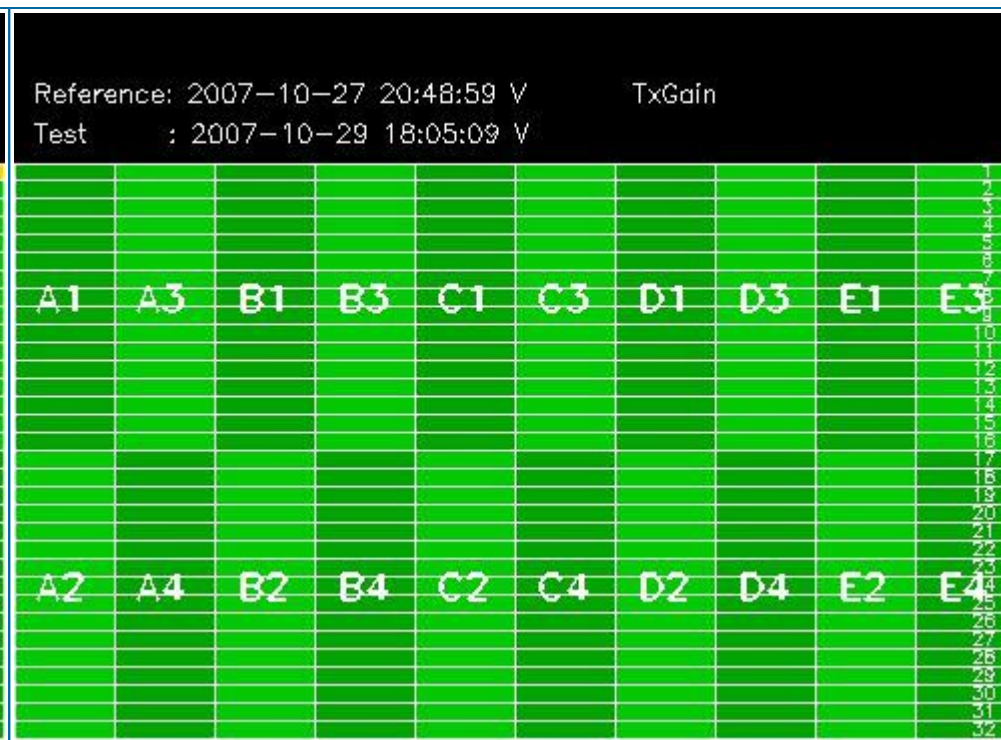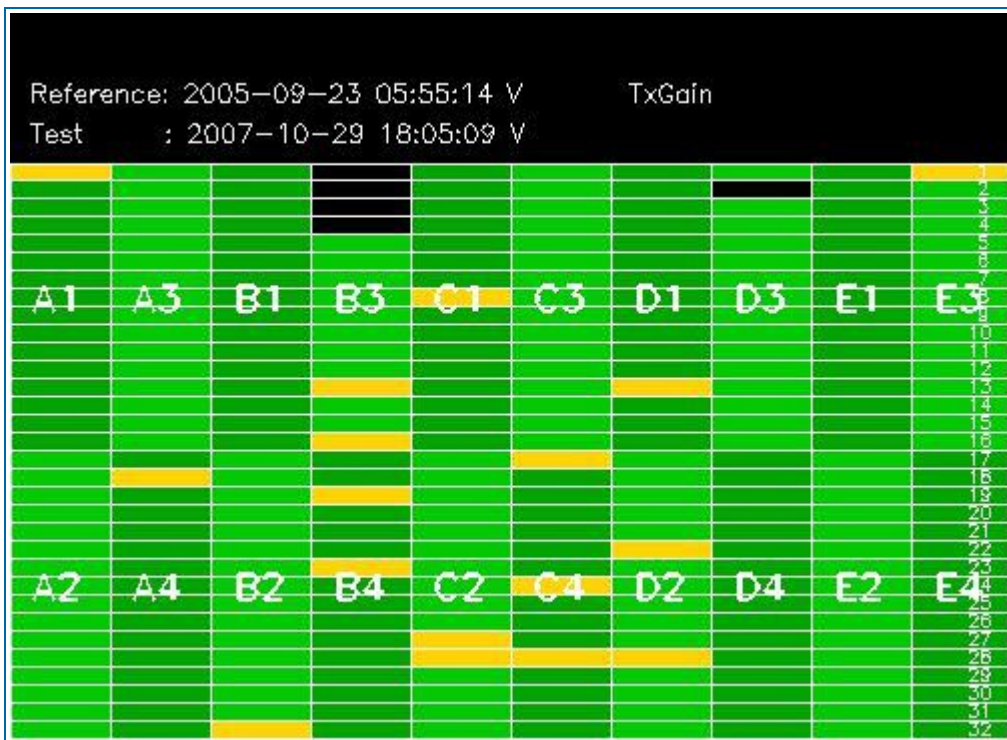

### 3.2 - H/H polarisation


[ [BACK TO MENU](#) ]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
After antenna maintenance (2005-09-22/23)	Previous product in the same polarisation


Reference: 2005-09-22 06:26:51 H RxGain  
 Test : 2007-10-30 17:33:32 H




Reference: 2007-10-28 18:36:46 H RxGain  
 Test : 2007-10-30 17:33:32 H



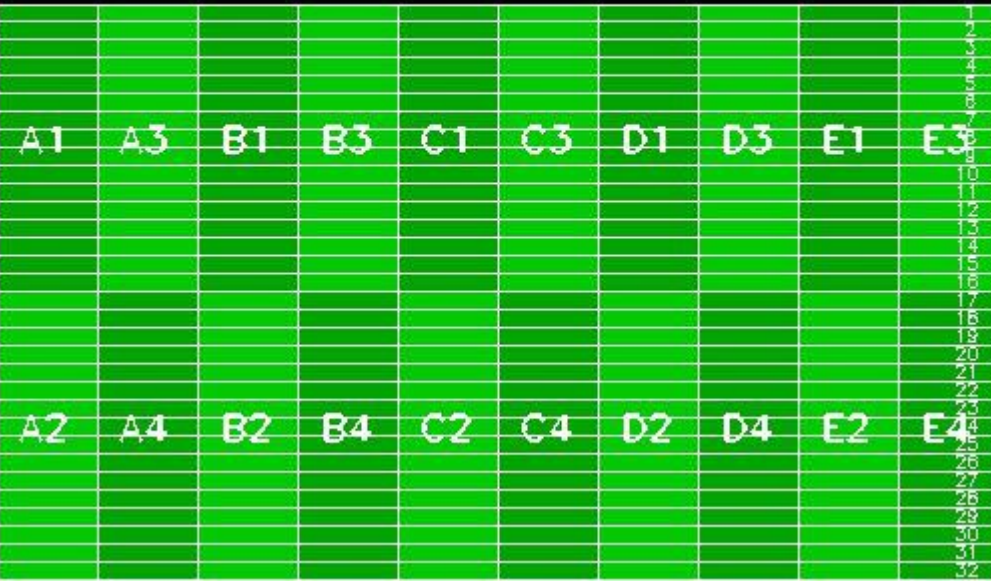


Reference: 2005-09-22 06:26:51 H RxPhase  
 Test : 2007-10-30 17:33:32 H

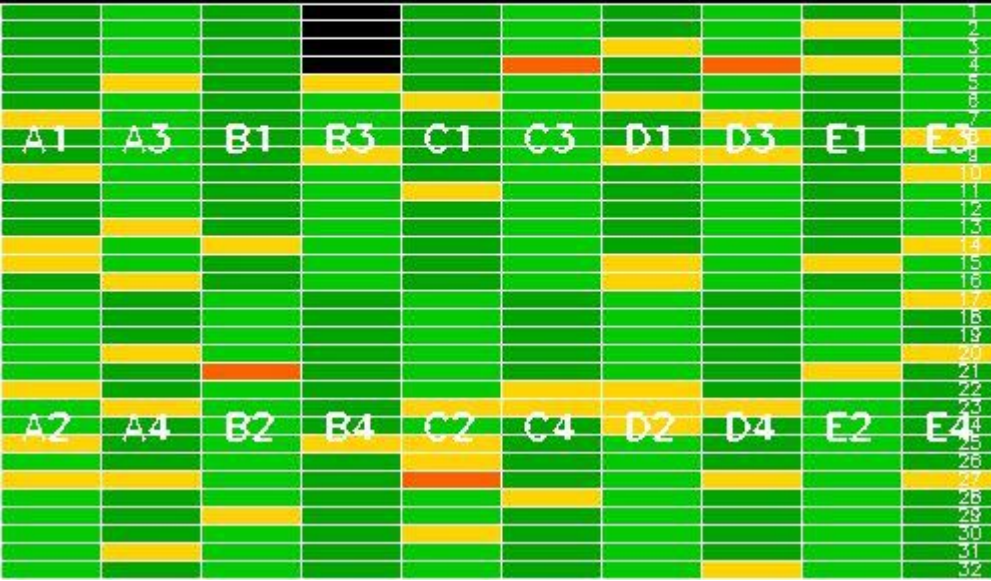

Reference: 2007-10-28 18:36:46 H RxPhase  
 Test : 2007-10-30 17:33:32 H

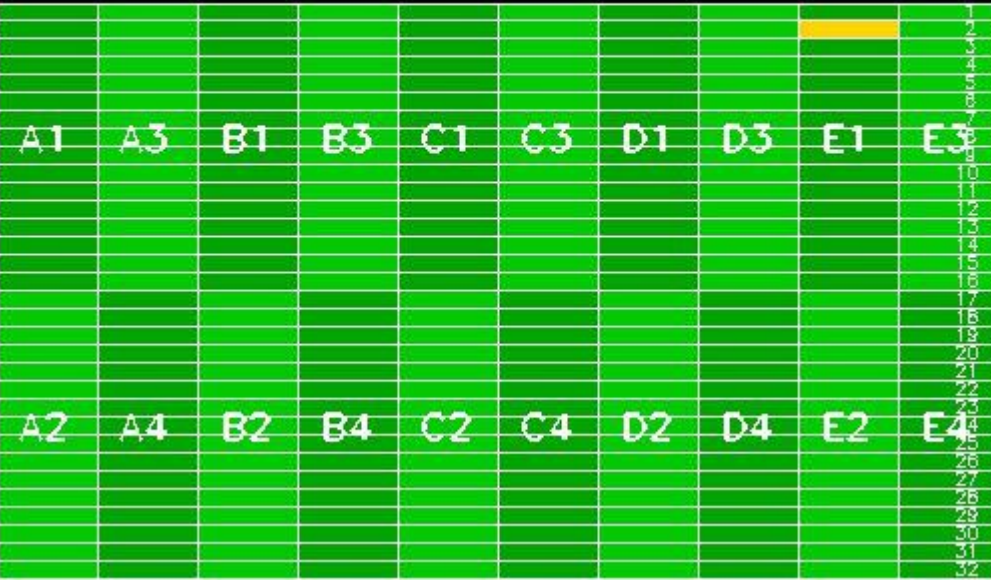

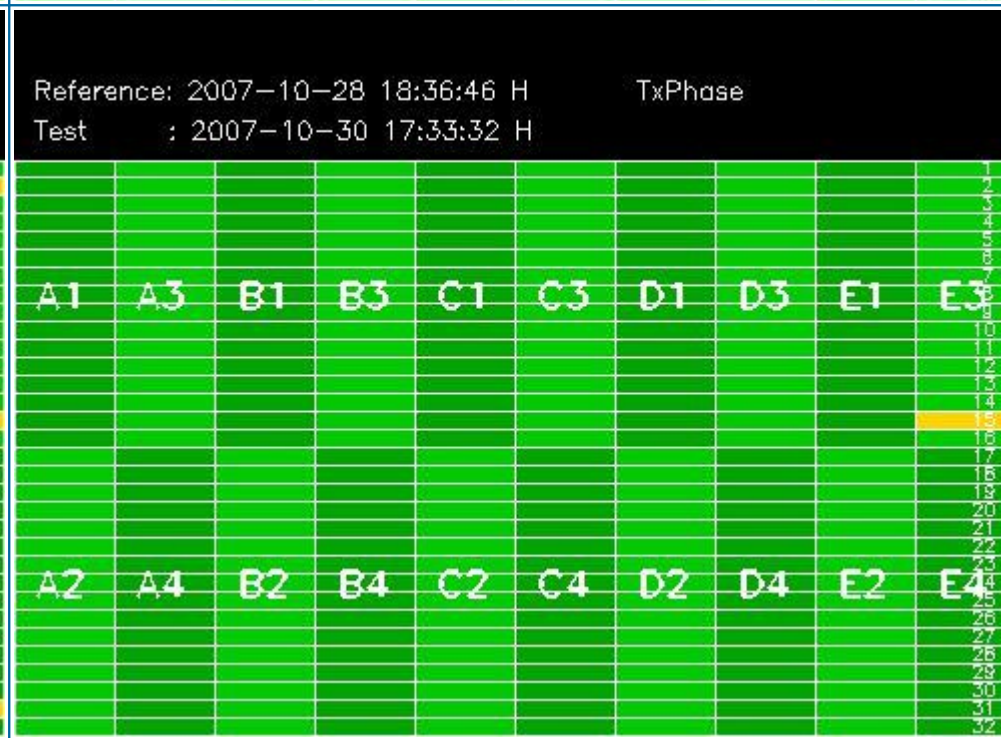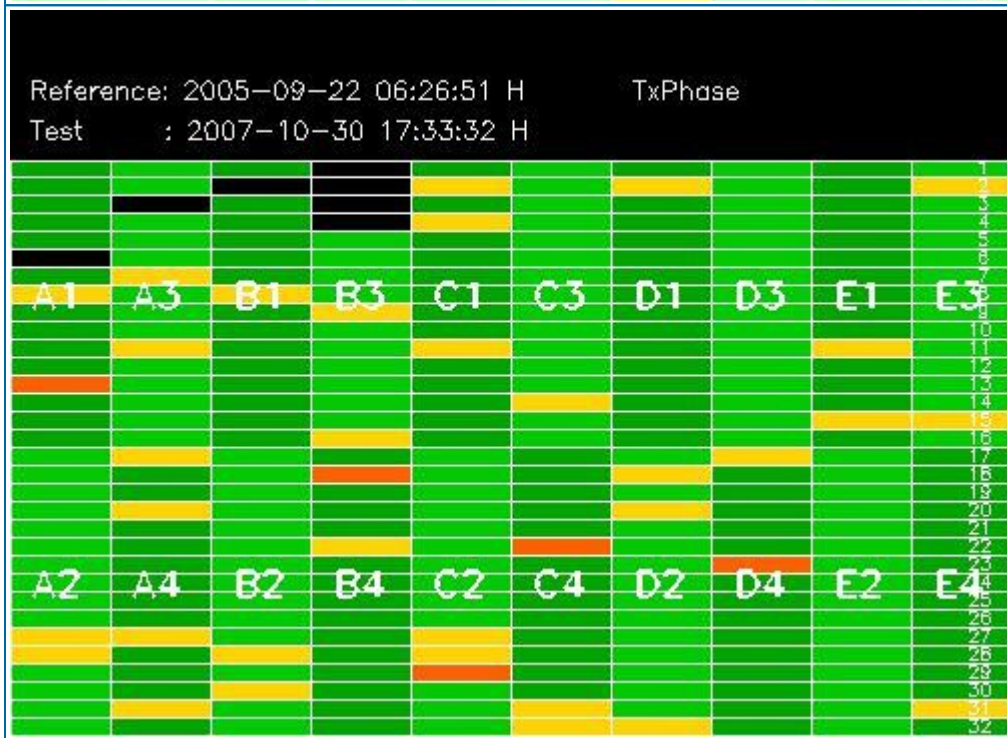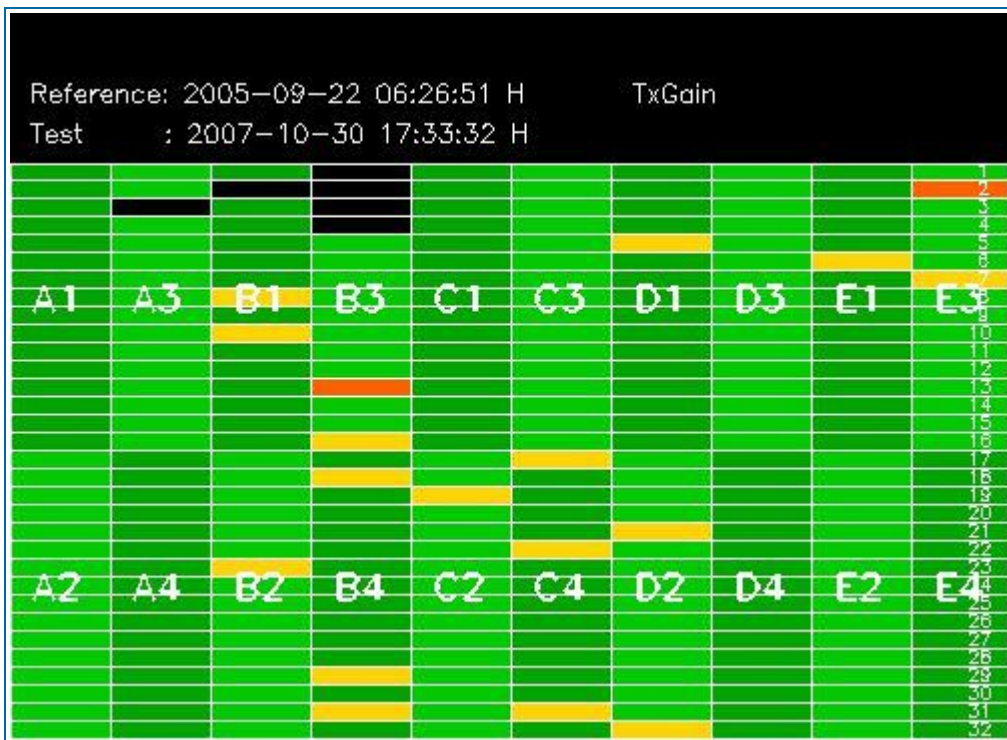

## 4 - CALIBRATION PULSES ANALYSIS

### 4.1 - Analysis for WVS IS2 V/V


#### 4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[ BACK TO MENU ]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for WVS IS2 V/V

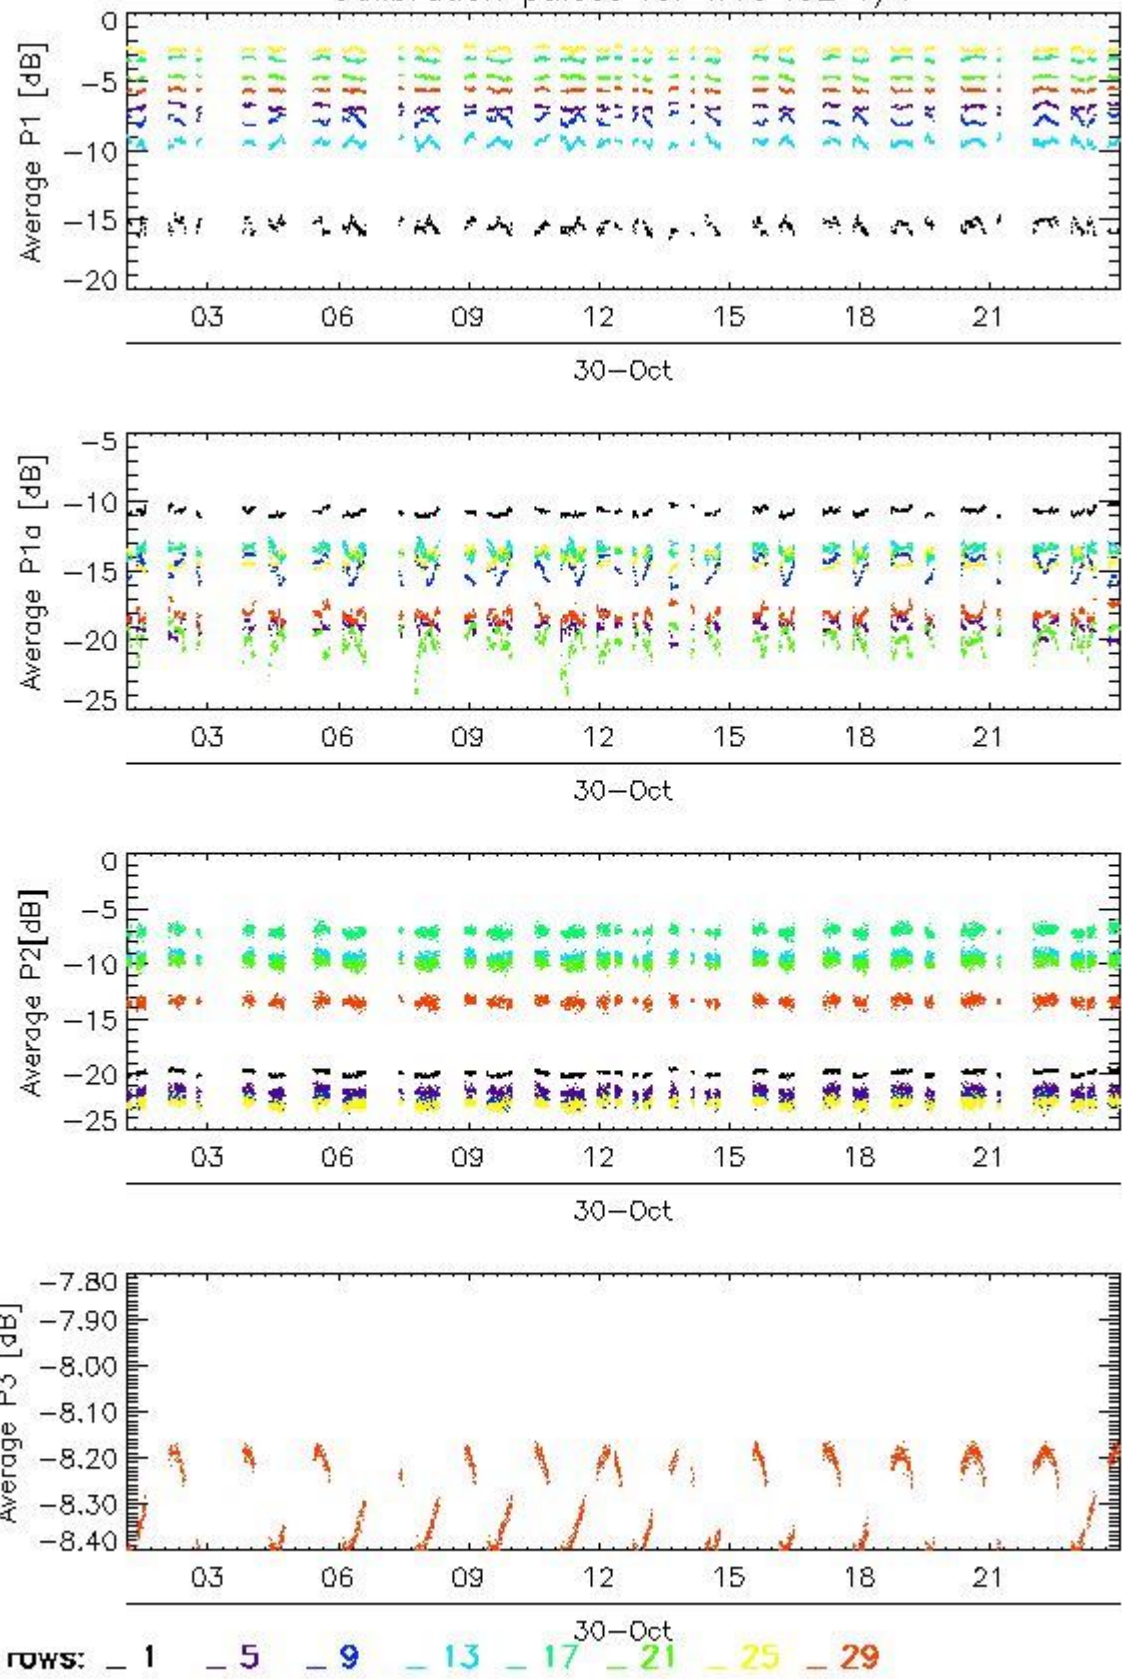


Transmit power (P1 - P1a) for WVS IS2 V/V

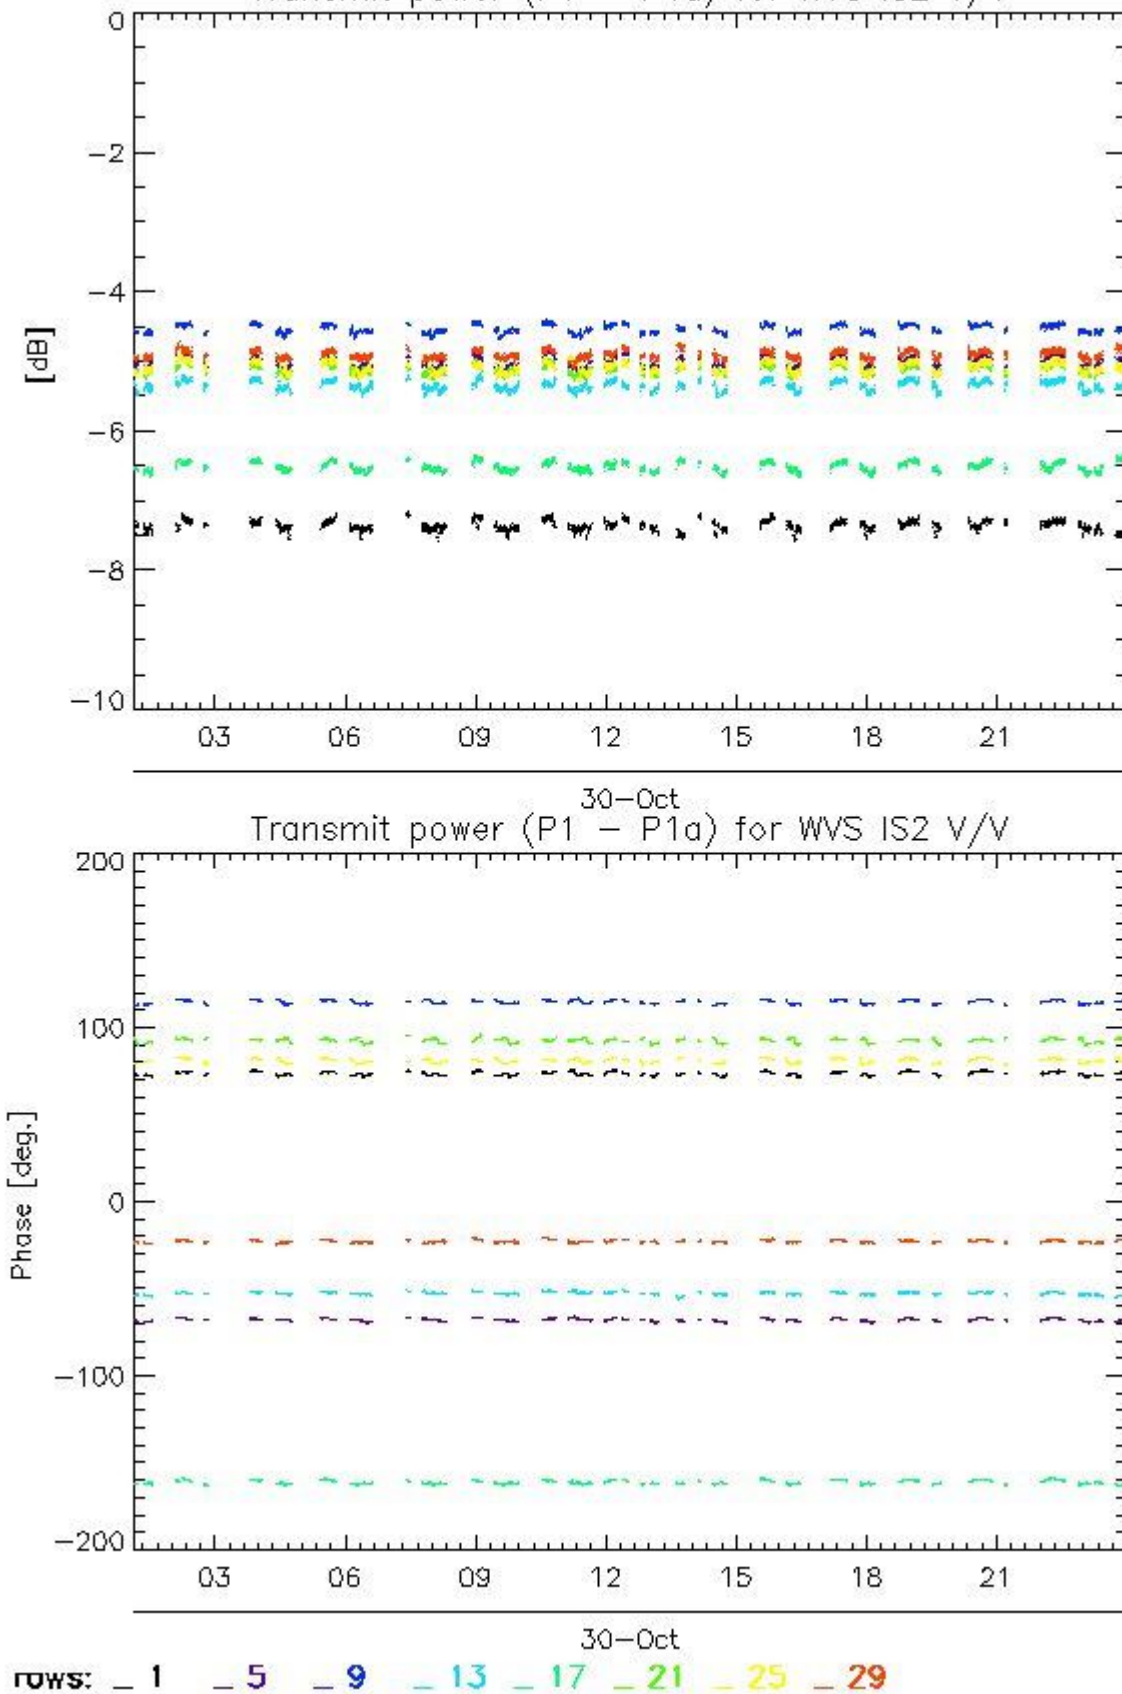

4.1.2 - All Rows Analysis for WVS IS2 V/V

[ BACK TO MENU ]



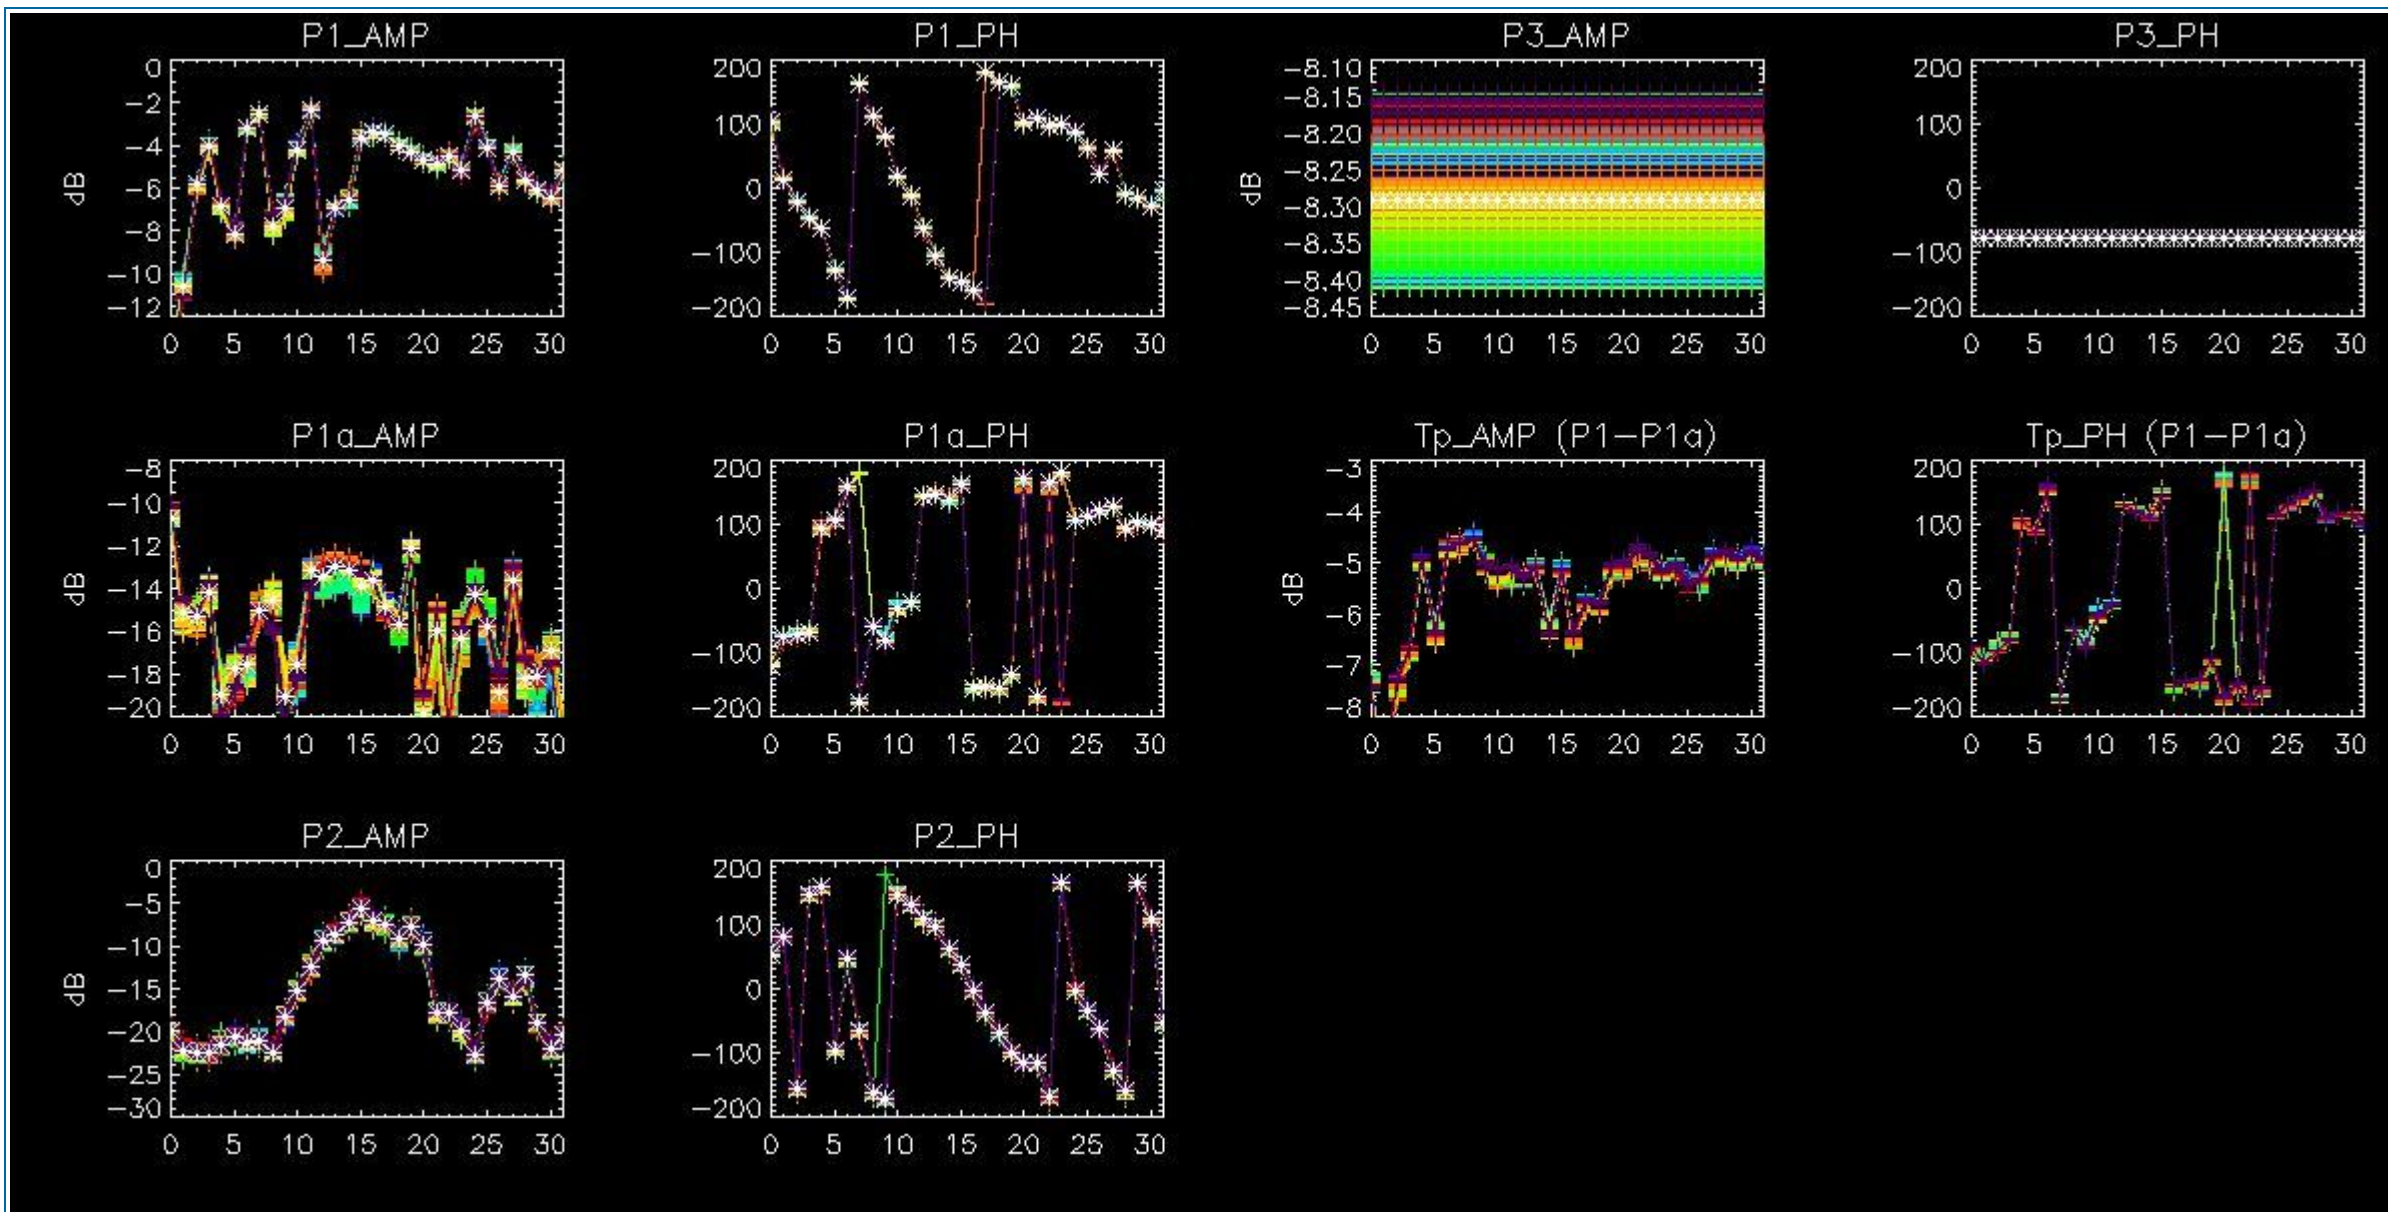

## 4.2 - Analysis for GM1 SS3 H/H

### 4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H


[ BACK TO MENU ]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]



Calibration pulses for GM1 SS3 H/H

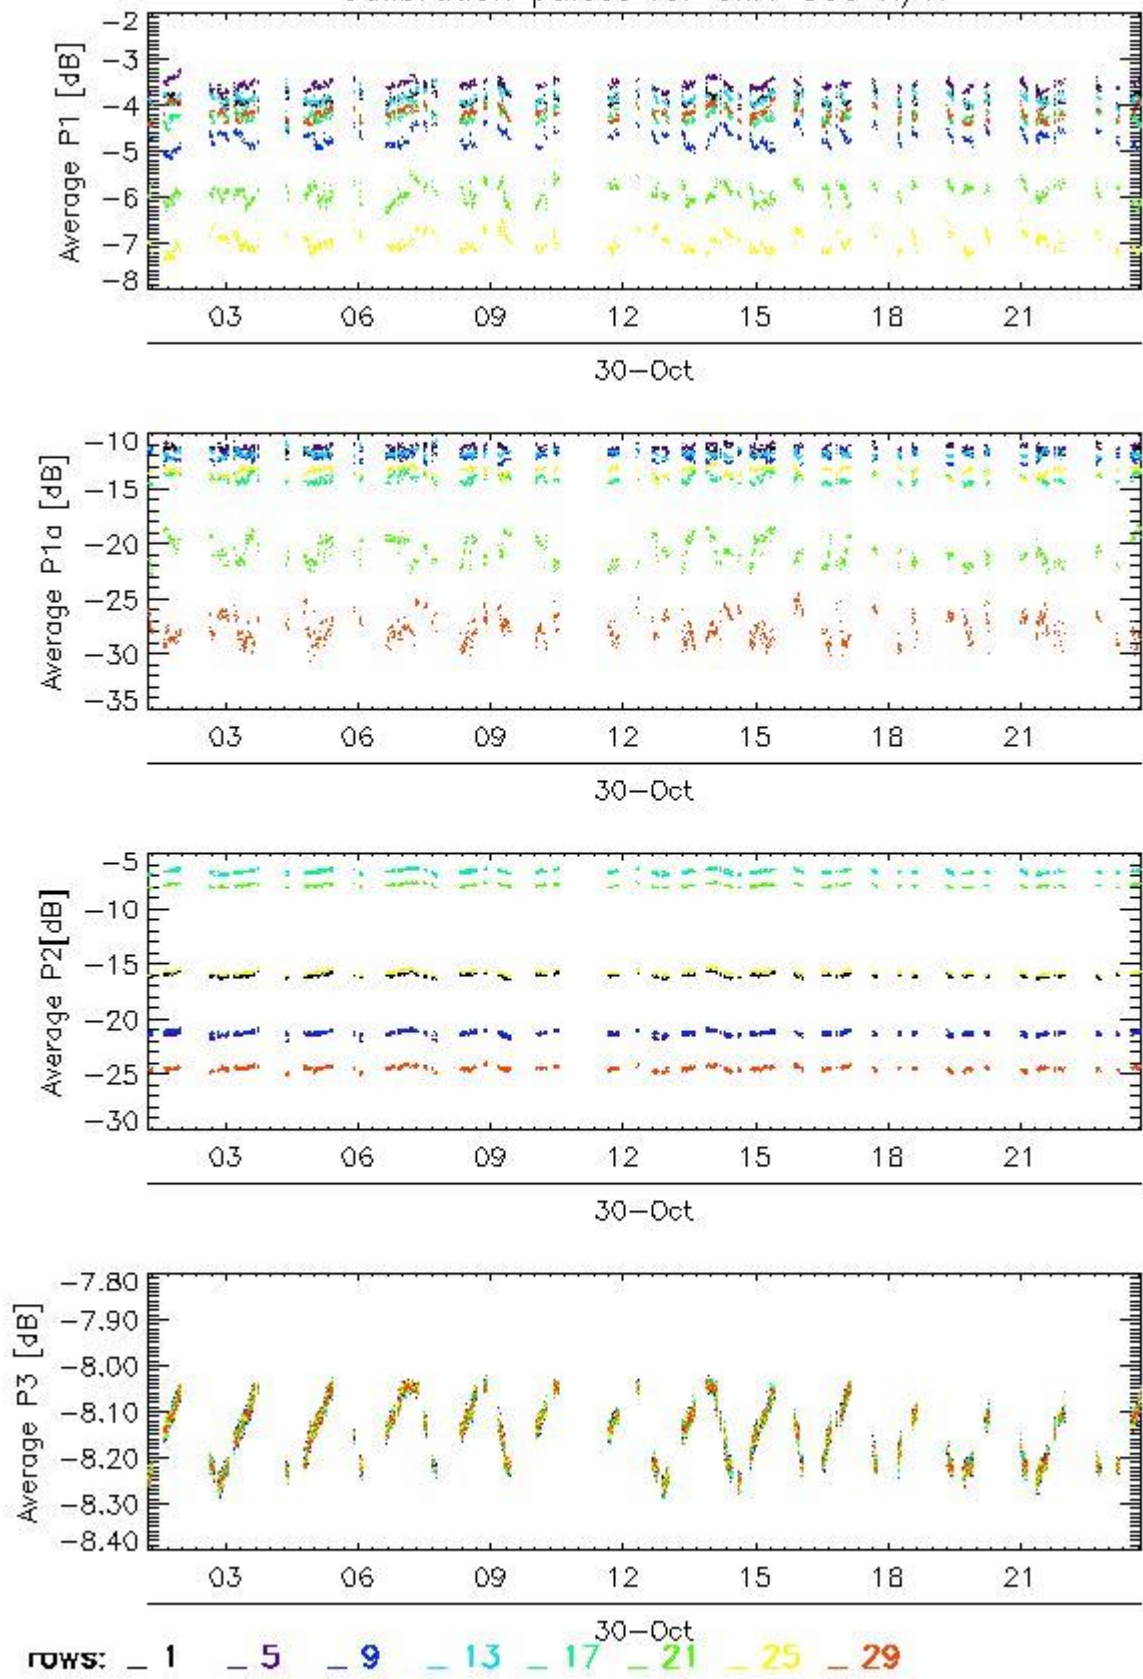


Transmit power (P1 - P1a) for GM1 SS3 H/H

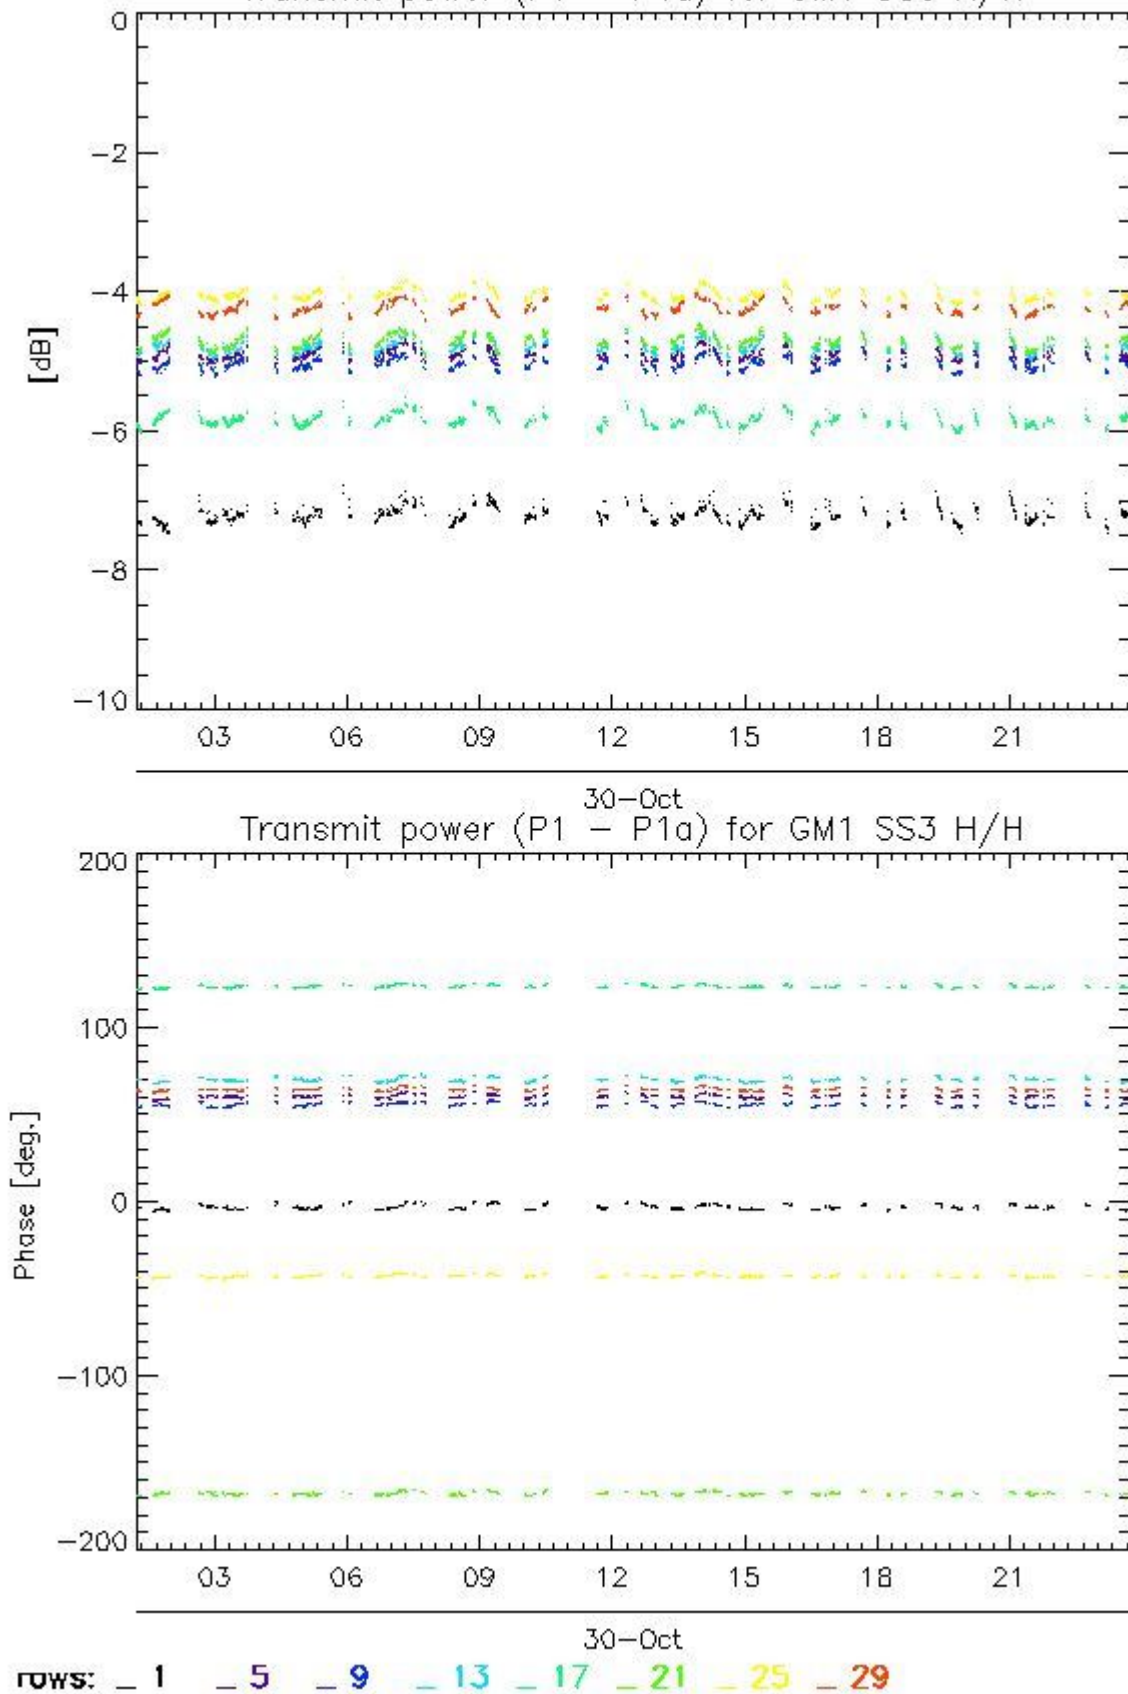

4.2.2 - All Rows Analysis for GM1 SS3 H/H

[ BACK TO MENU ]



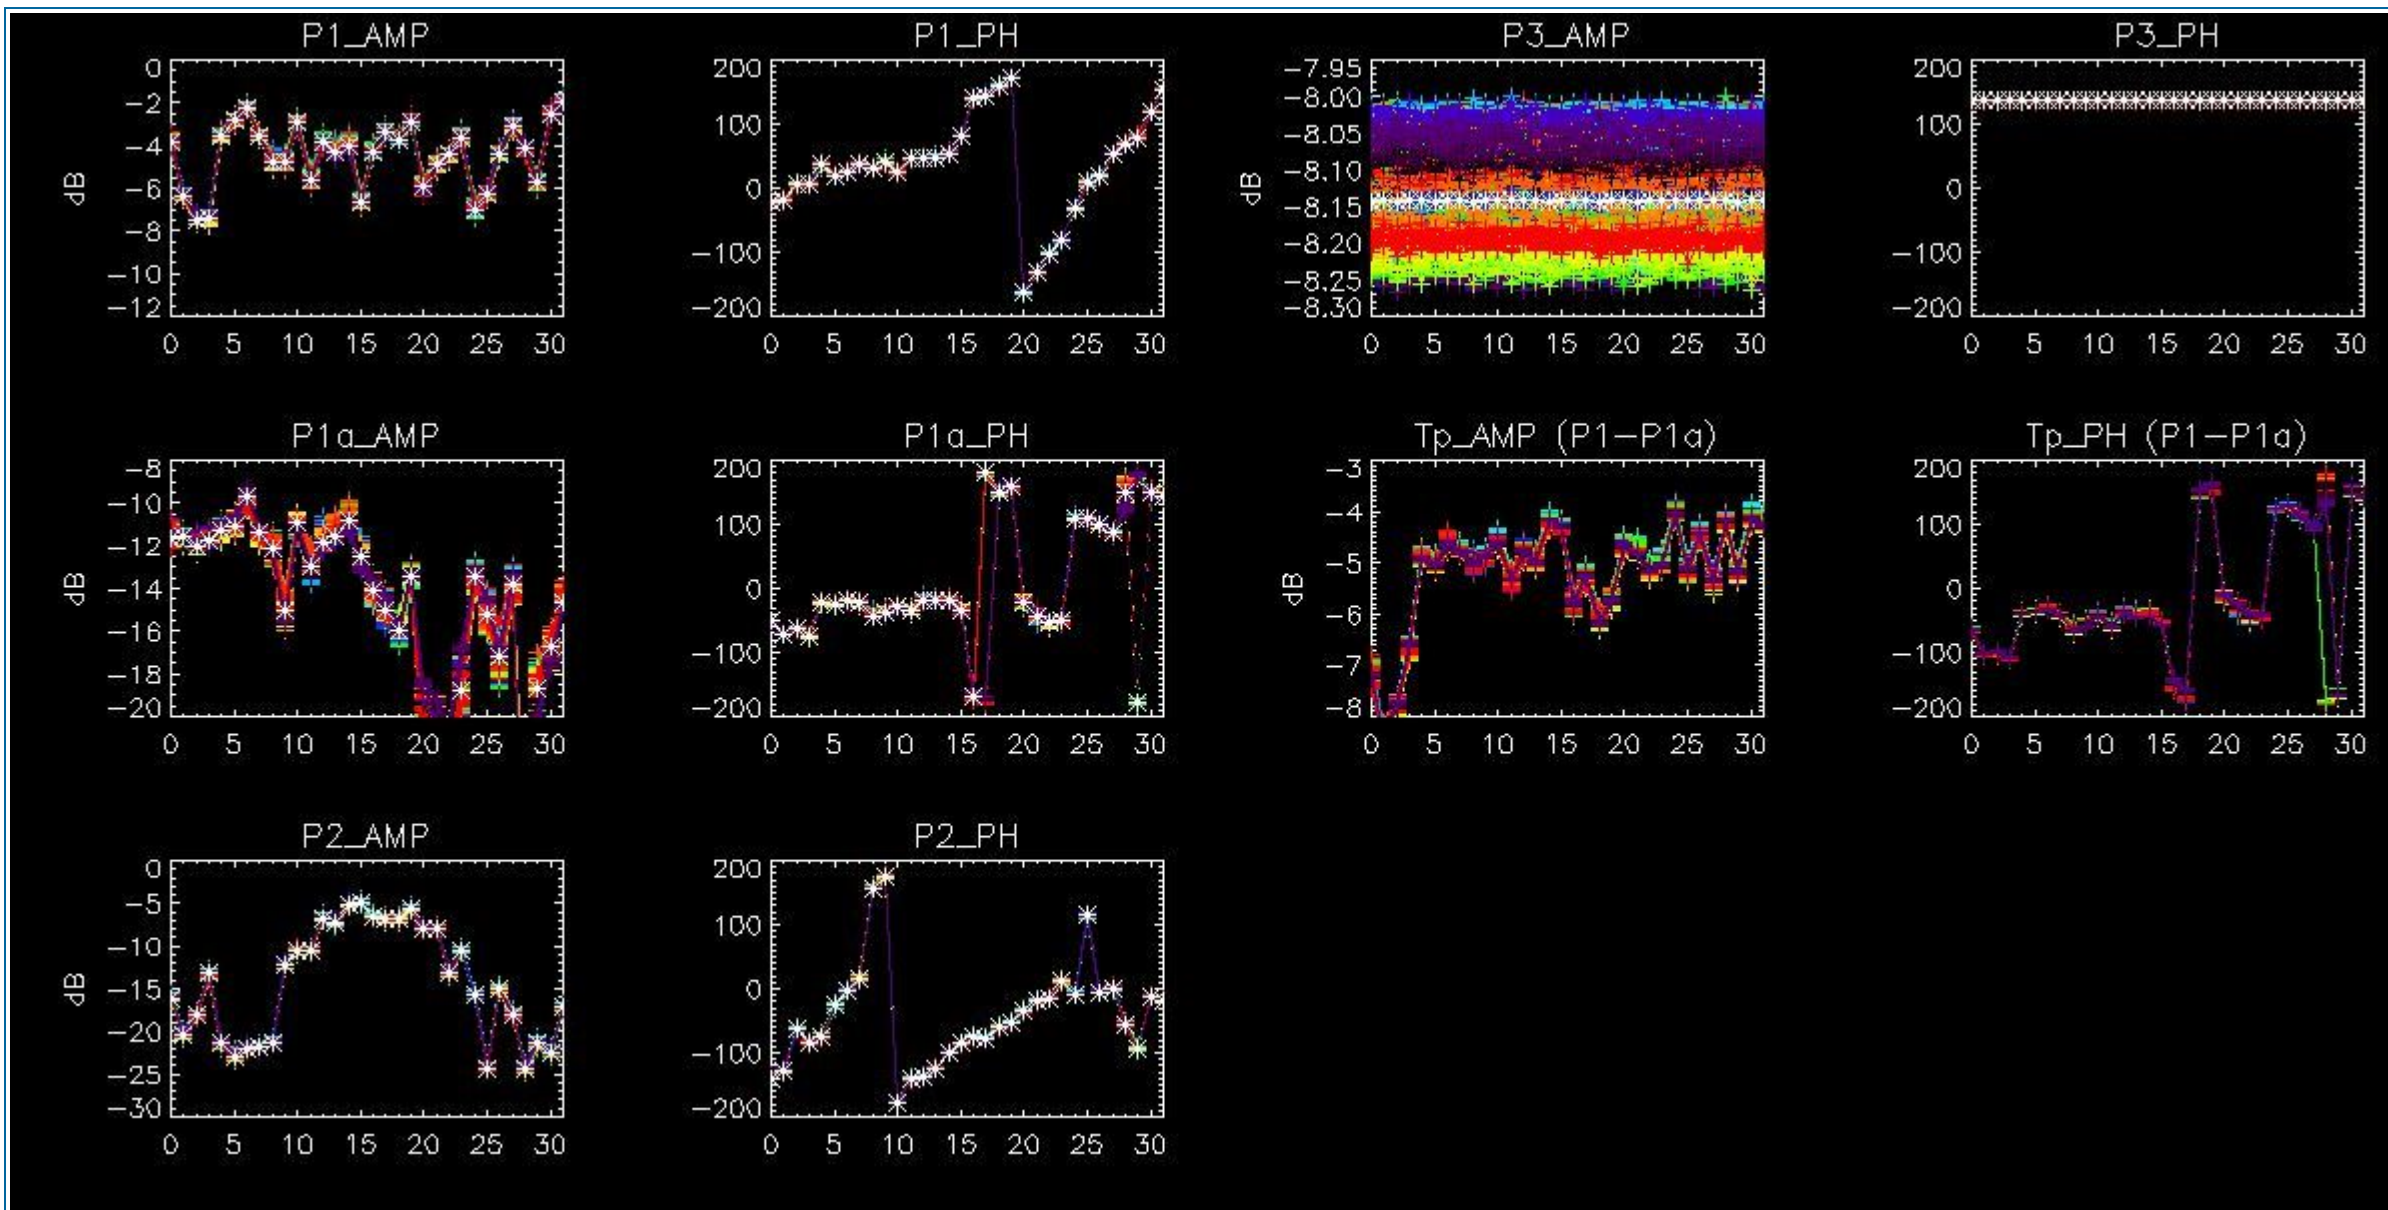


## 5 - DOPPLER ANALYSIS

### 5.1 - Analysis for WVS IS2 V/V

#### 5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[ [BACK TO MENU](#) ]




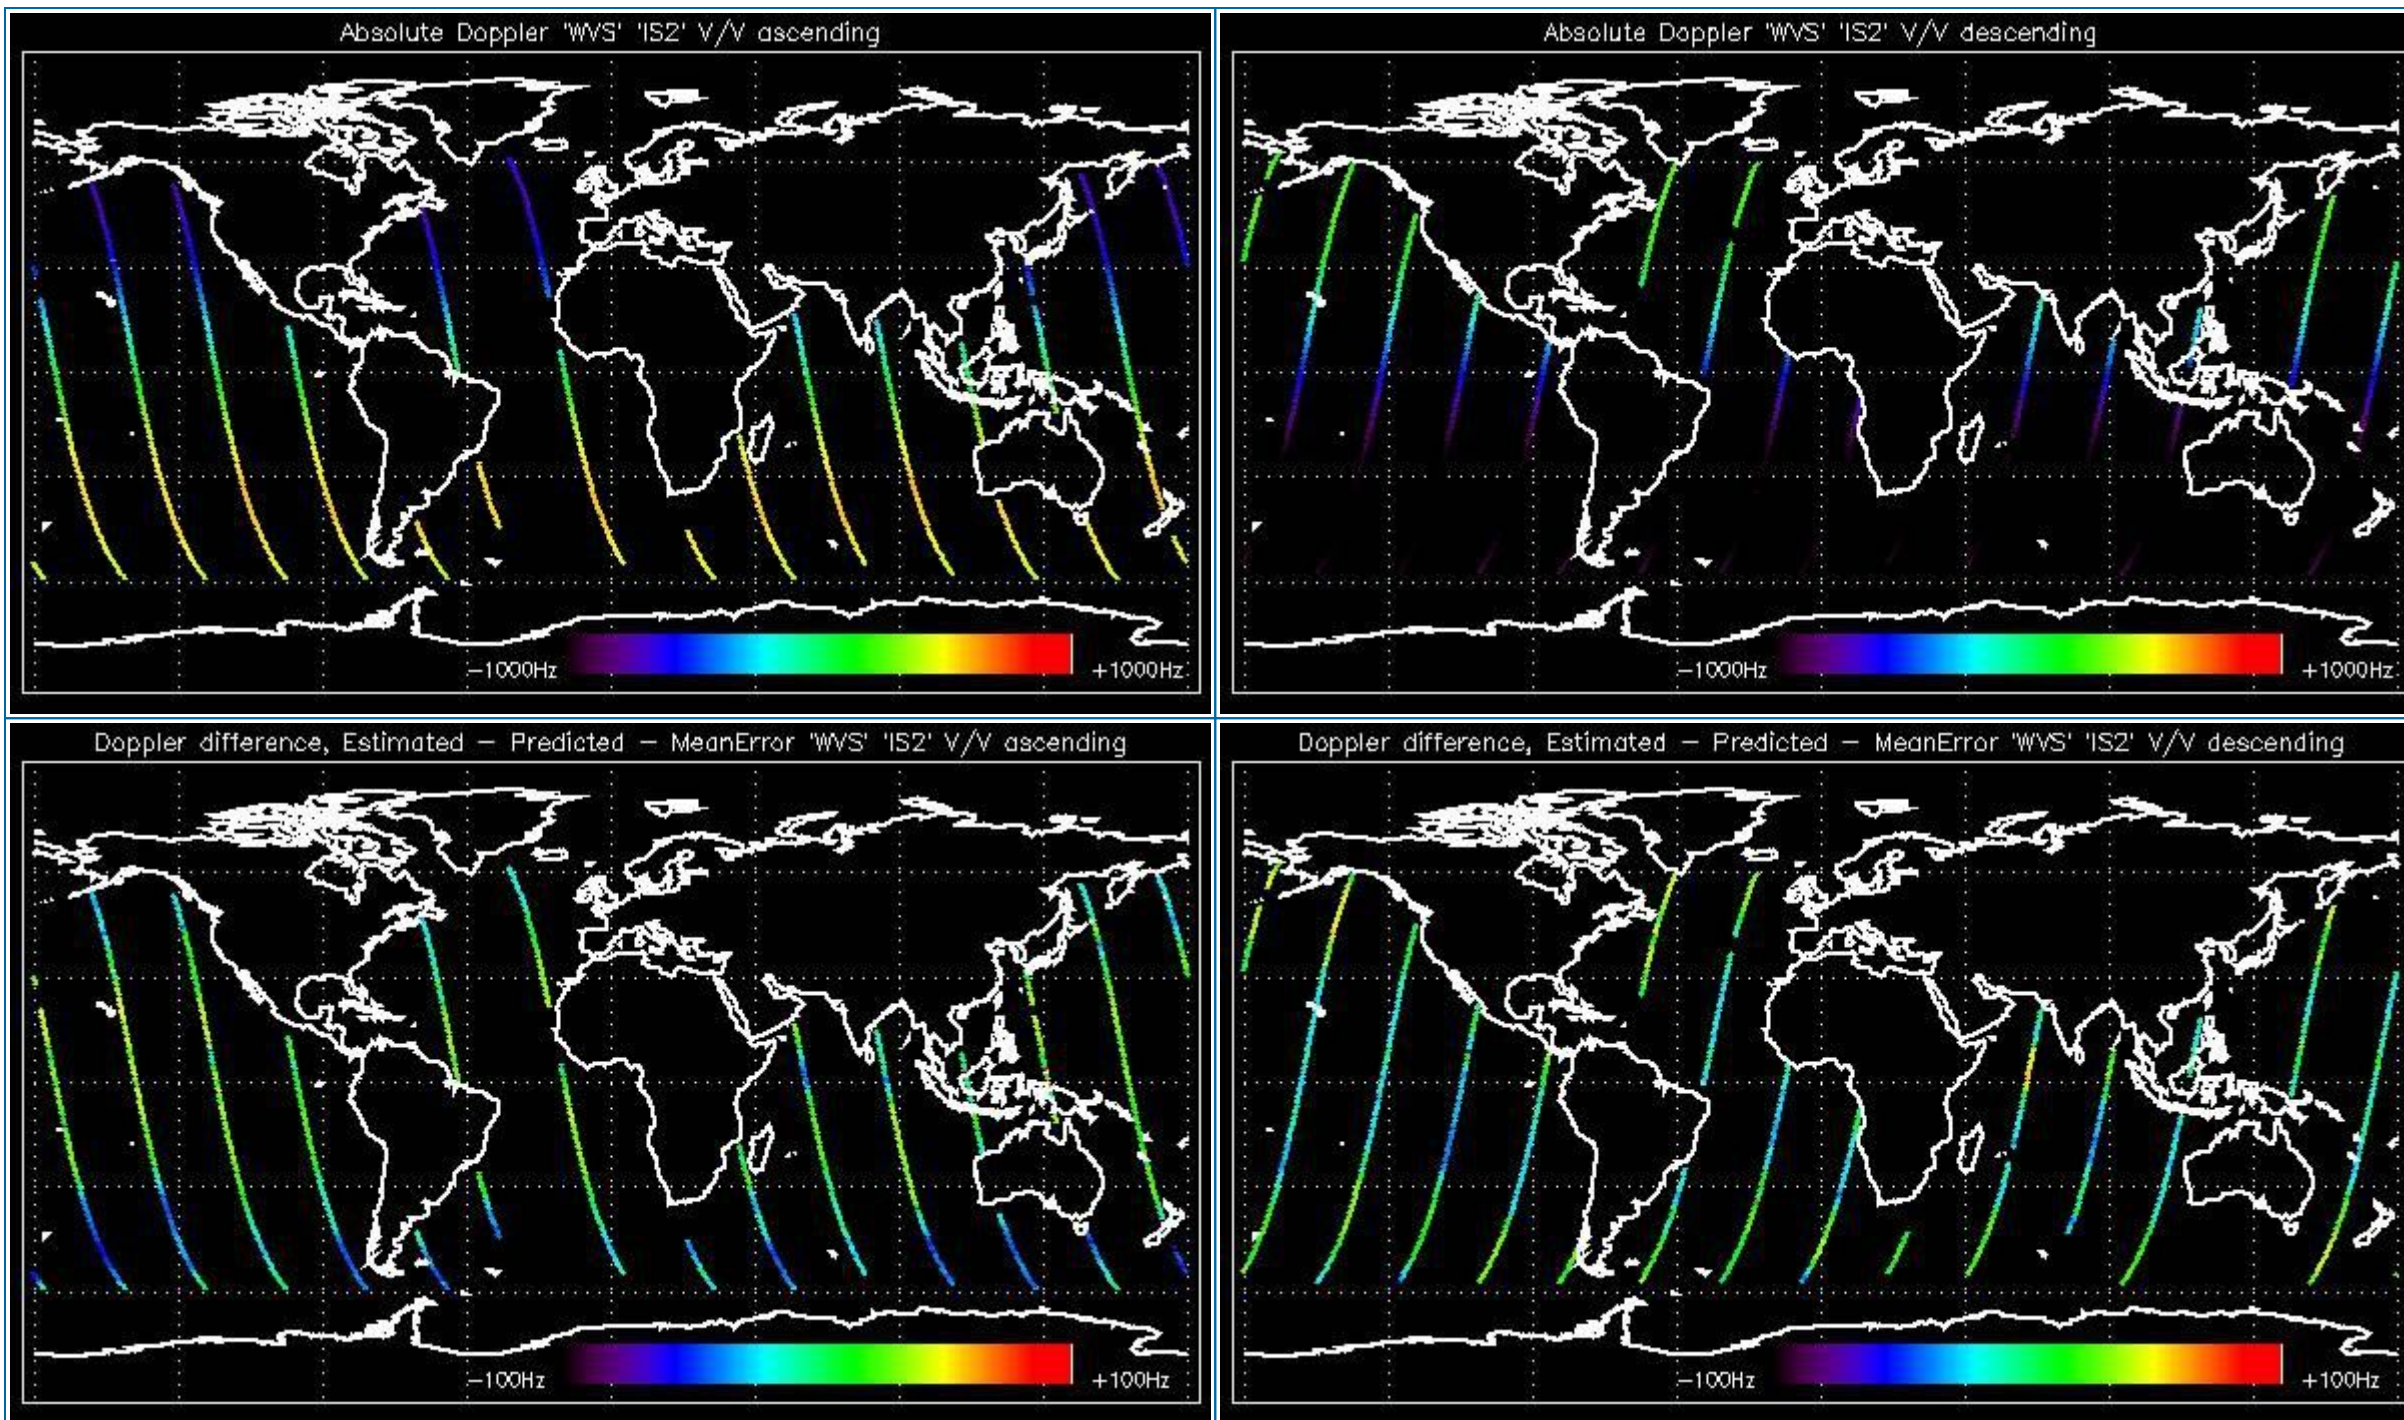

### 5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[ [BACK TO MENU](#) ]



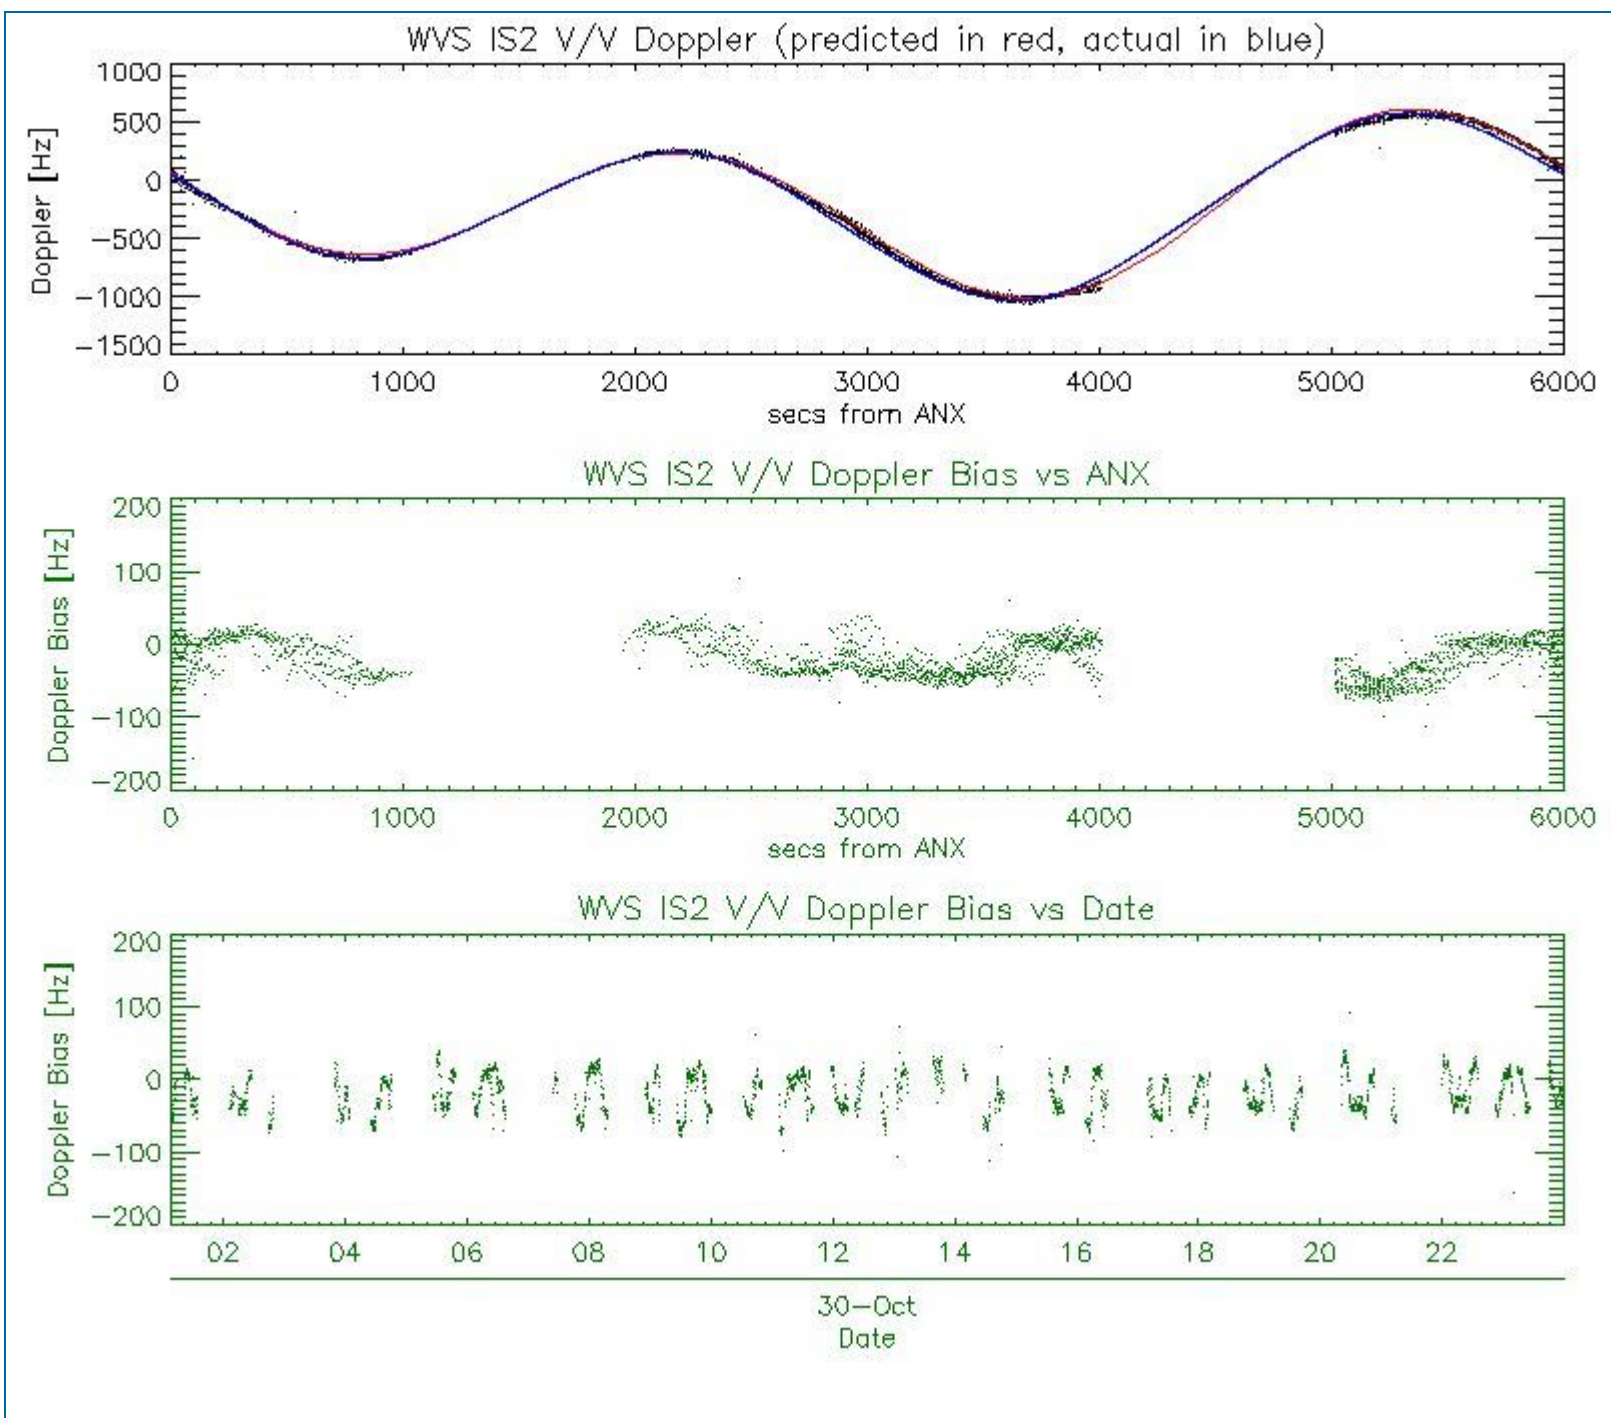


## 5.2 - Analysis for GM1 SS1 H/H

### 5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[ [BACK TO MENU](#) ]




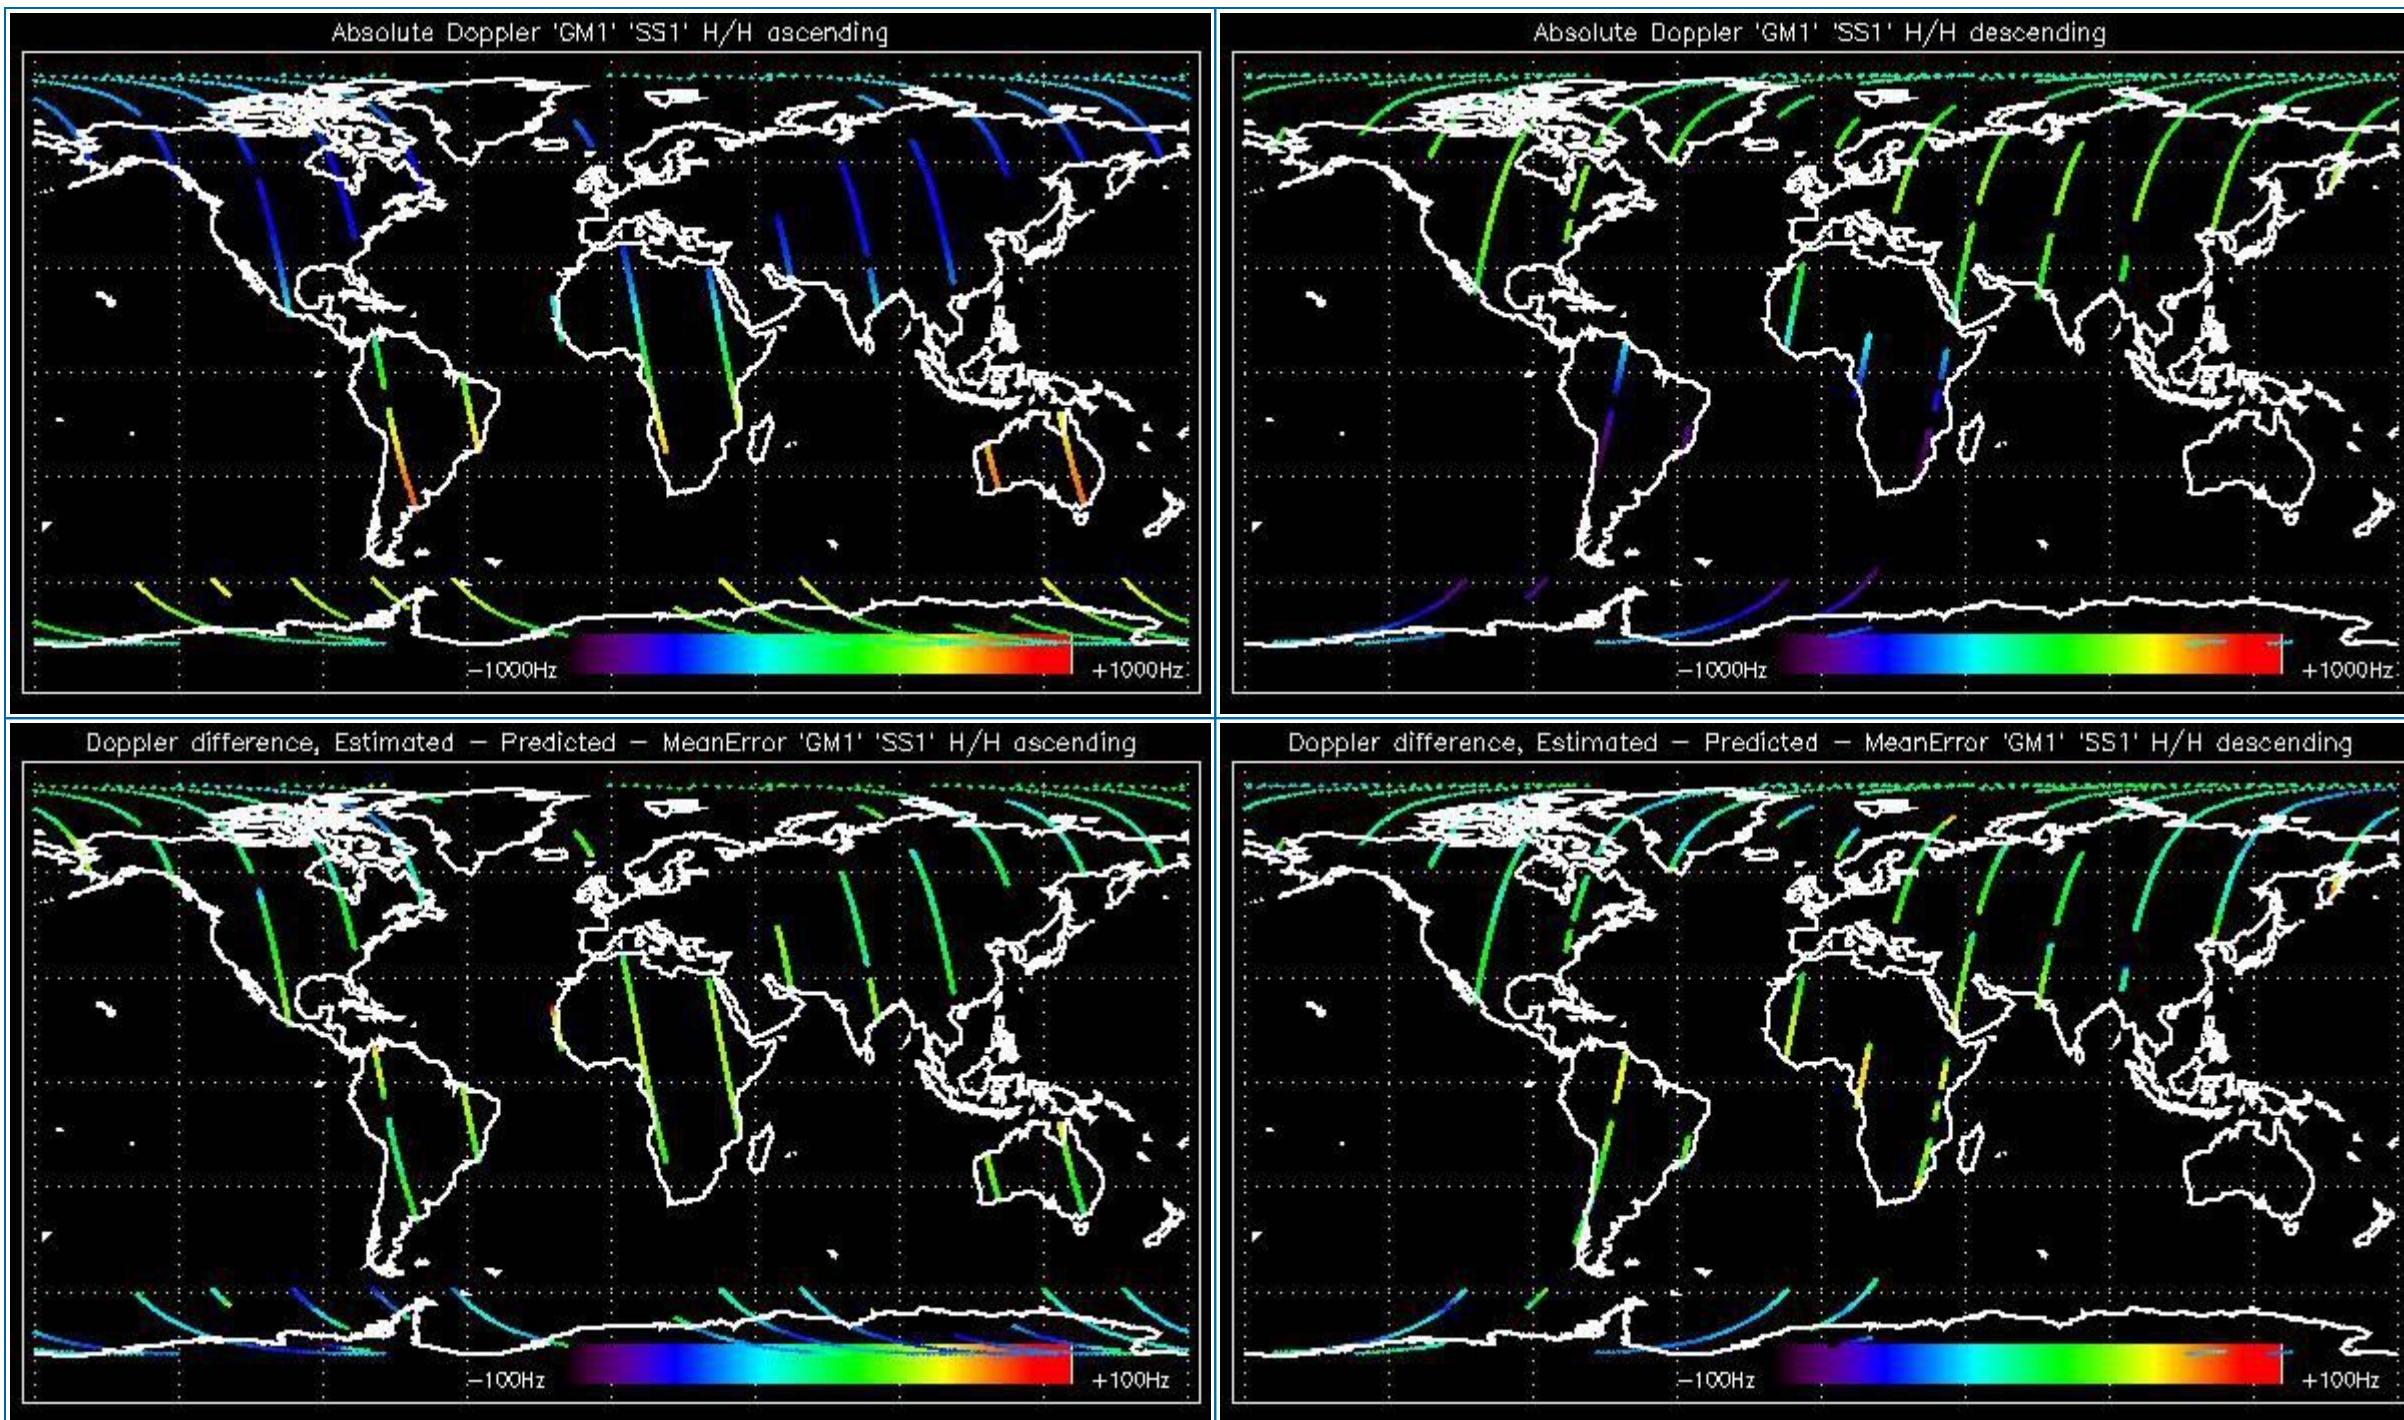

### 5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[ [BACK TO MENU](#) ]




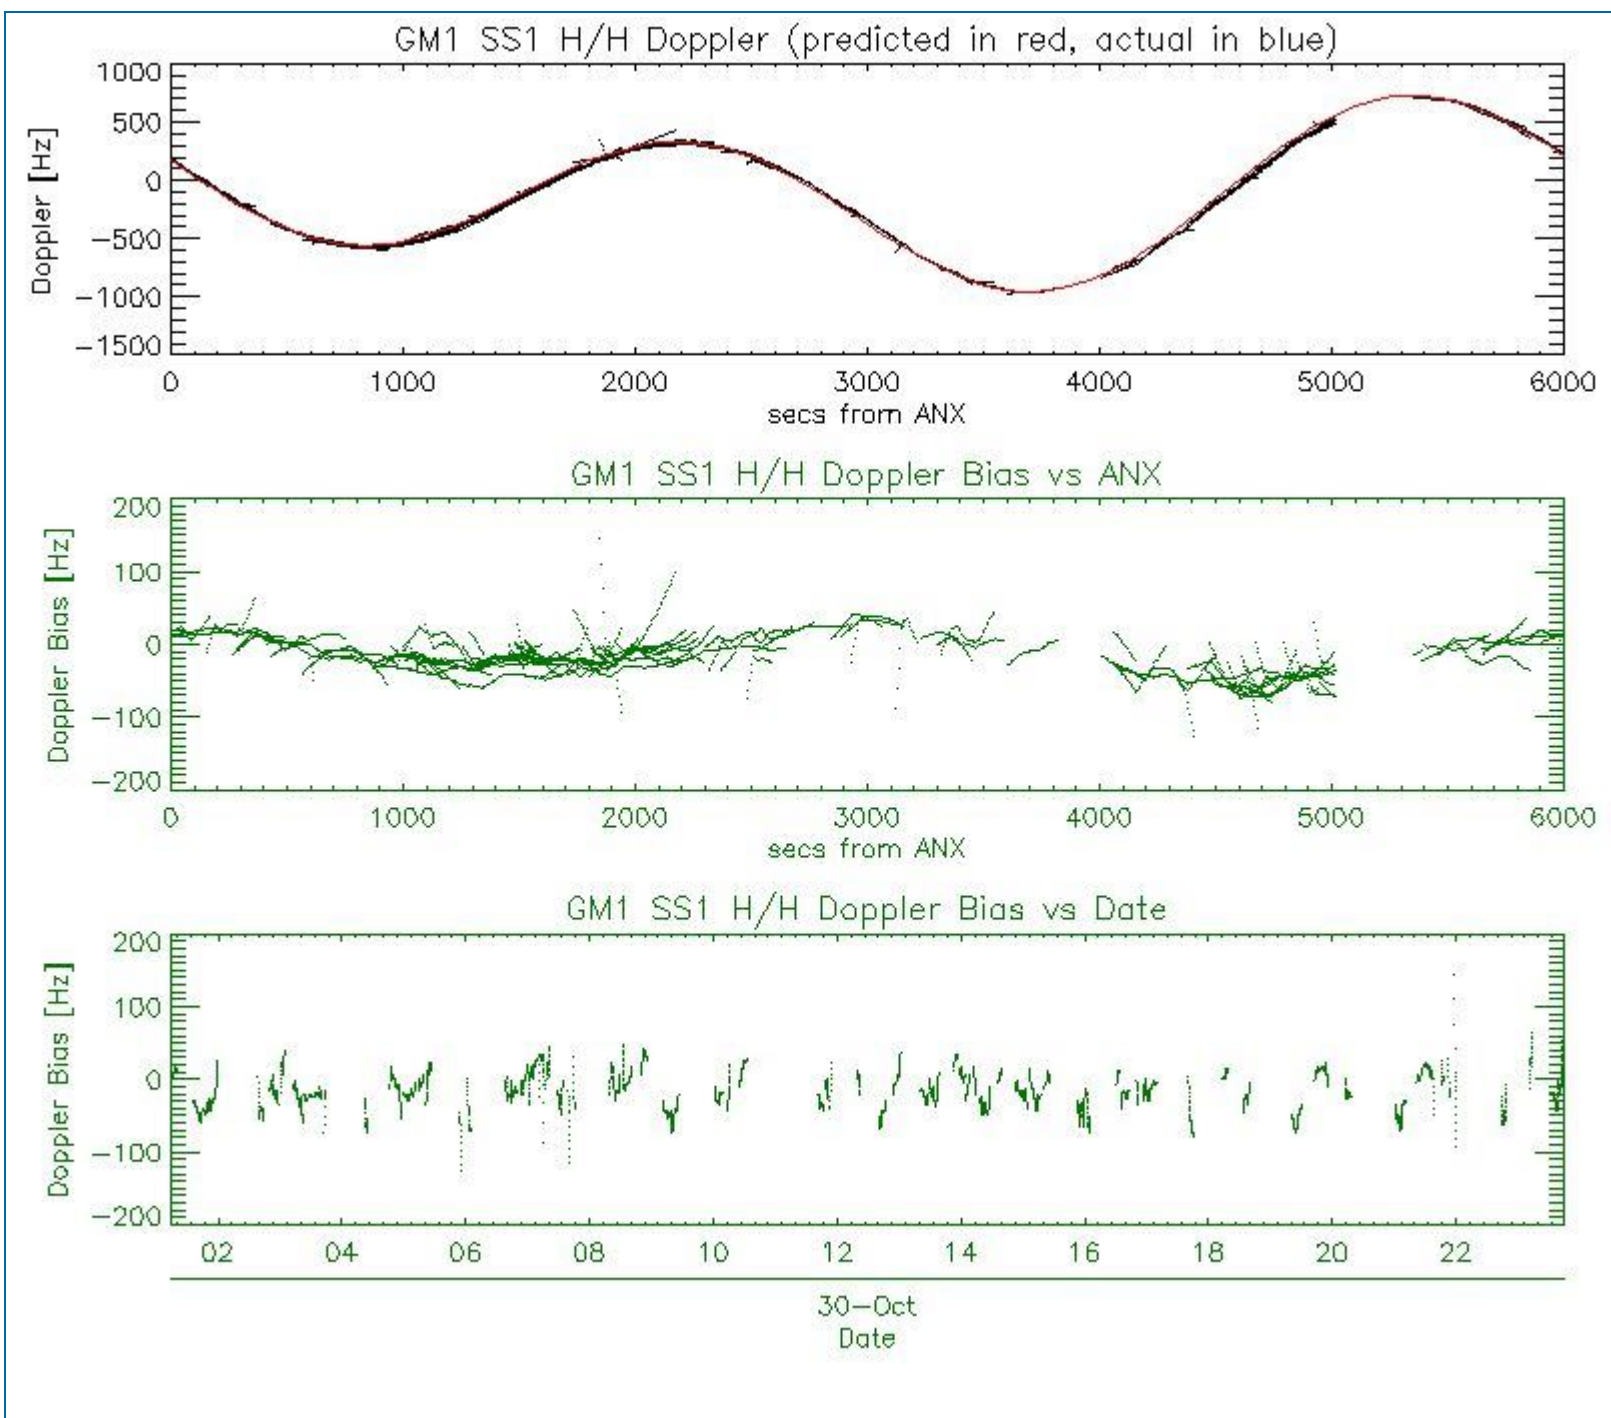

### 5.3 - Doppler JUMPS Analysis for WSM

[ [BACK TO MENU](#) ]



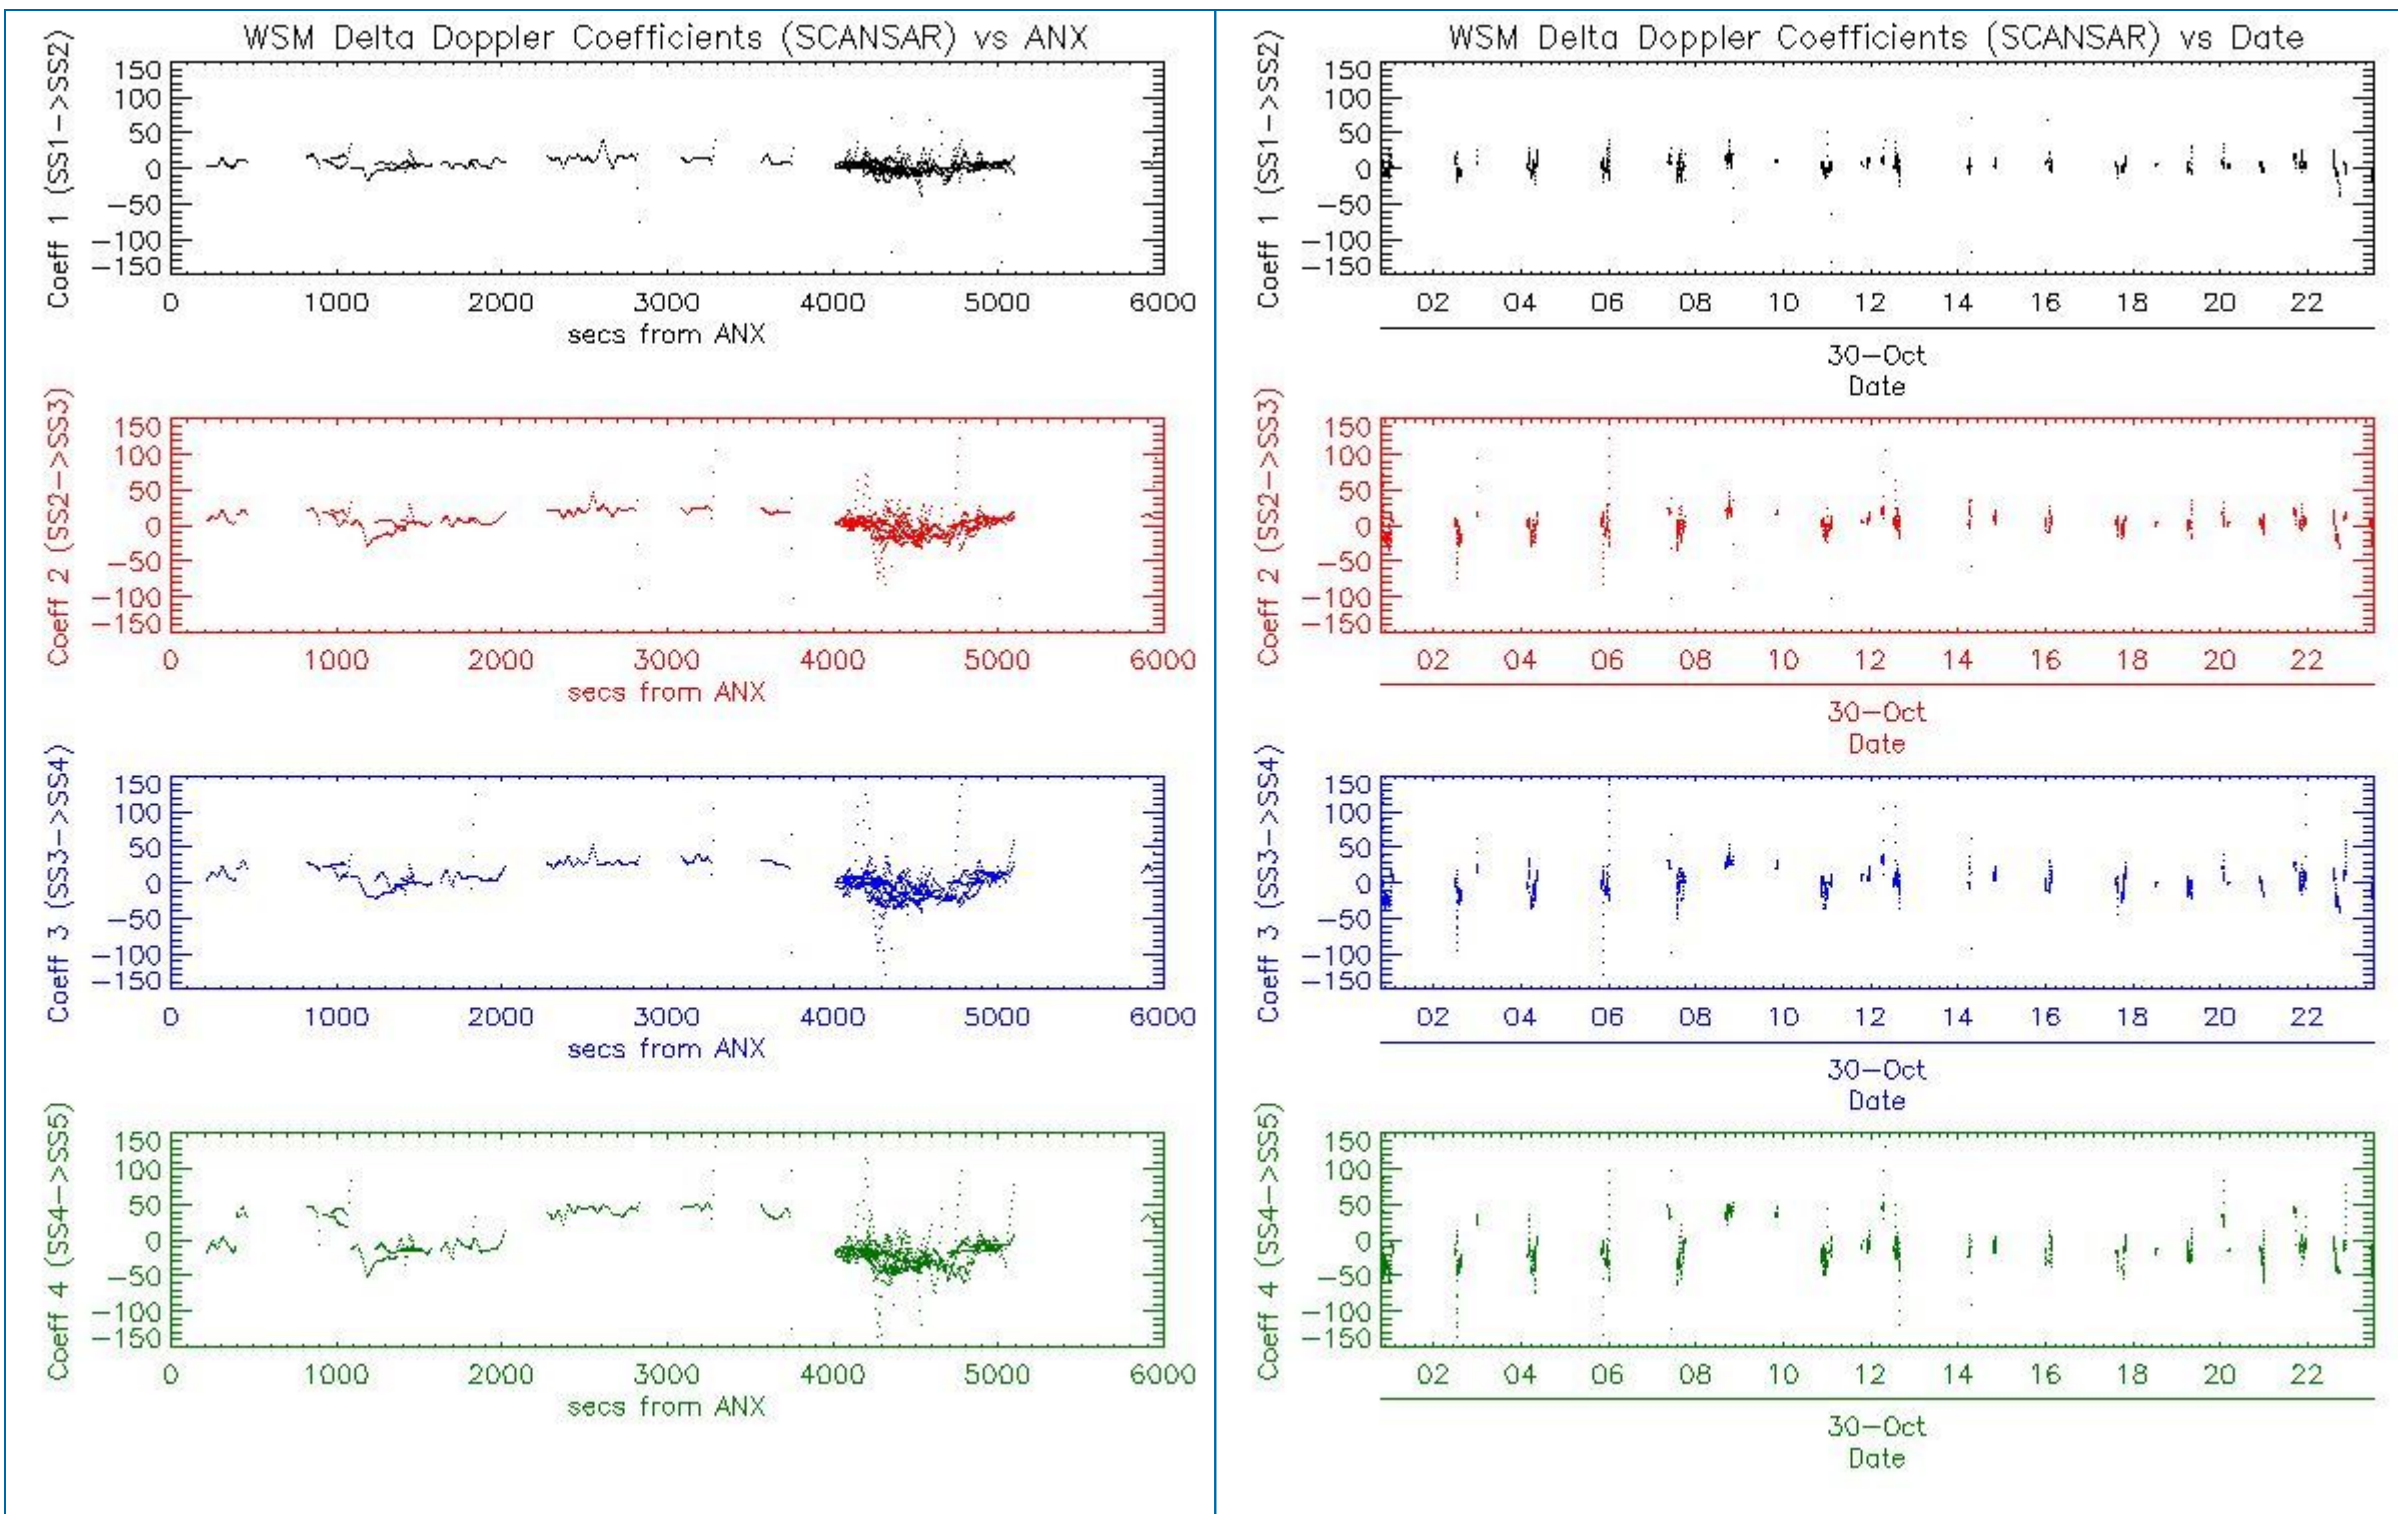




## 6 - CHIRP ANALYSIS

### 6.1 - Analysis for WSM SS1 H/H

#### 6.1.1 - ScaleFactor

[ [BACK TO MENU](#) ]





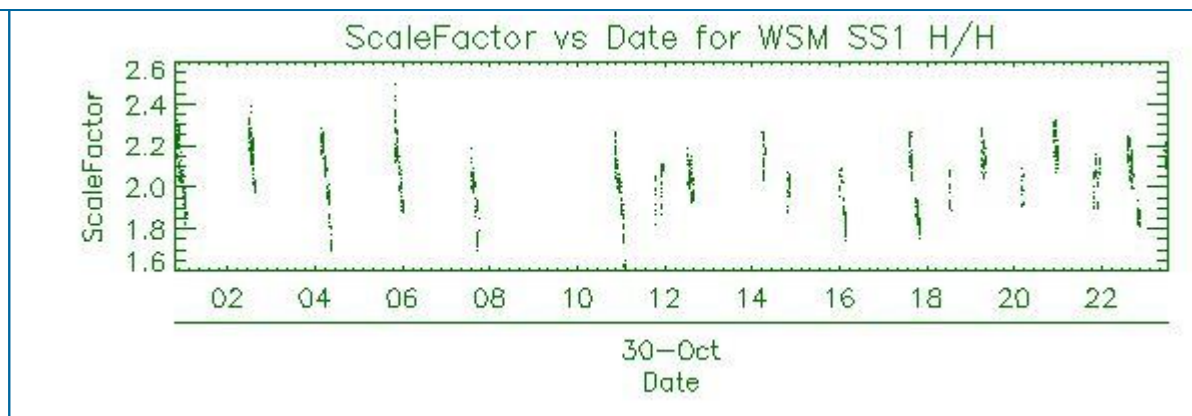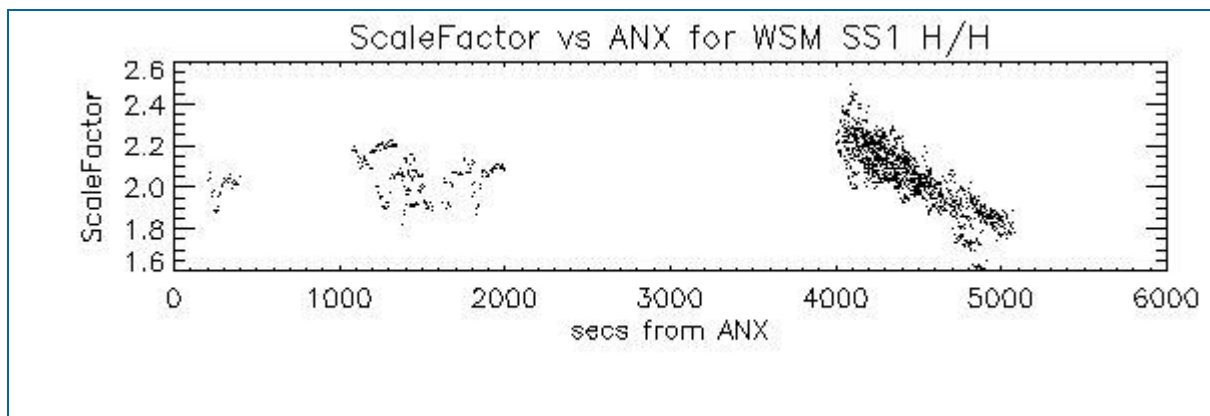

## 6.2 - Analysis for WSM SS1 V/V

### 6.2.1 - ScaleFactor

[ [BACK TO MENU](#) ]

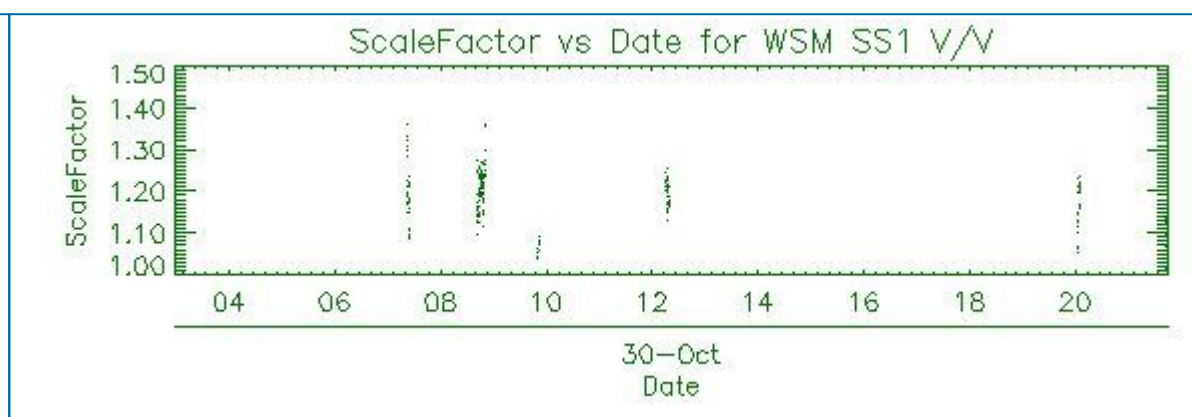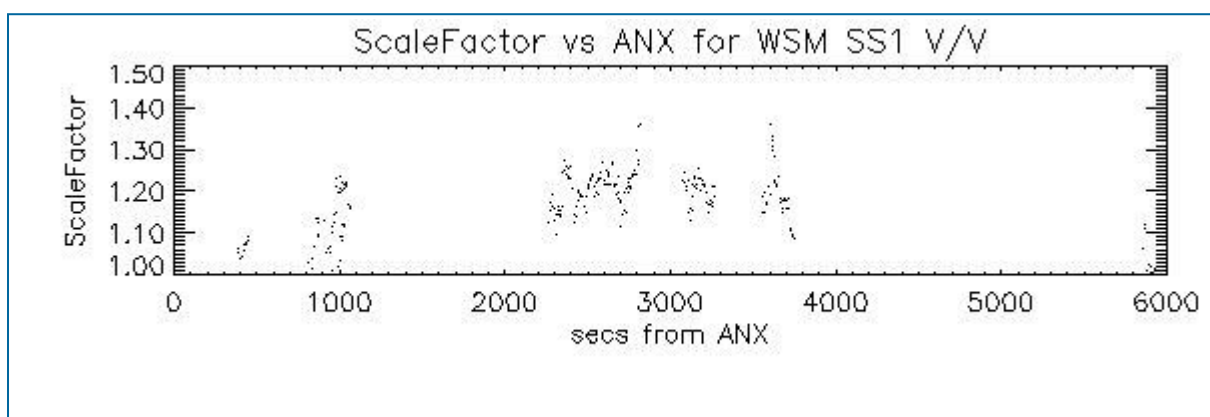




## 7 - RAW DATA ANALYSIS

### 7.1 - Analysis for WVS

[ [BACK TO MENU](#) ]

--	--	--



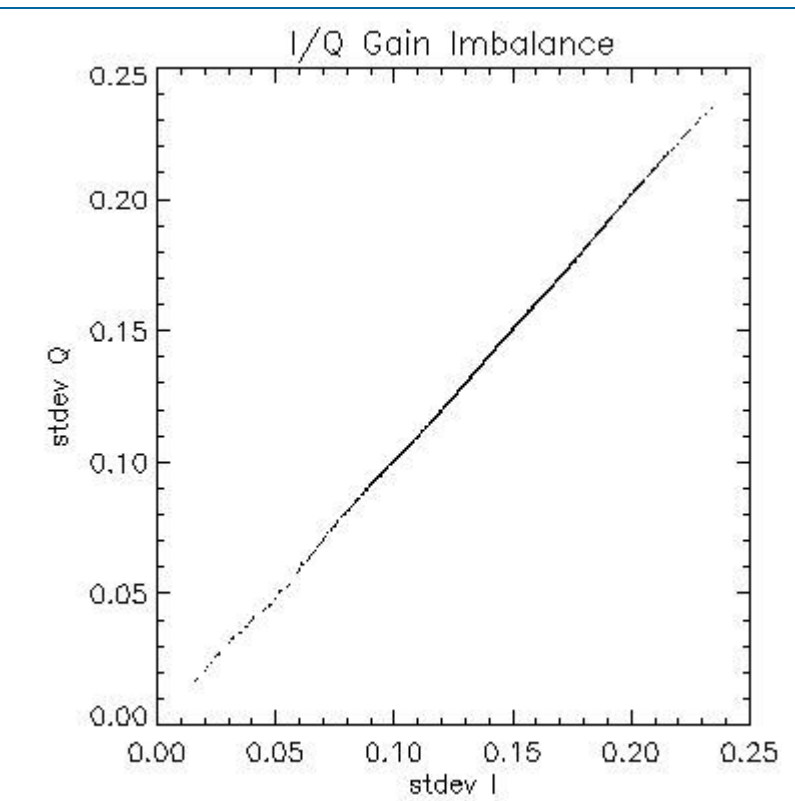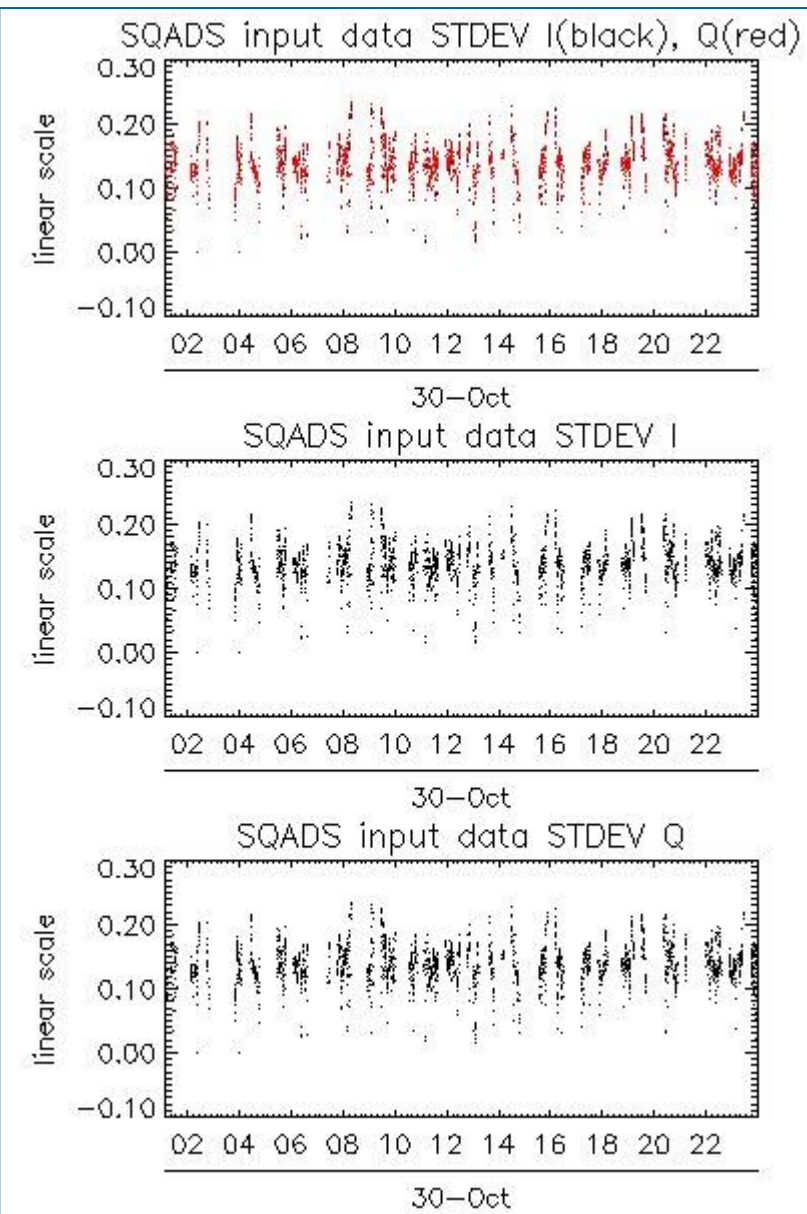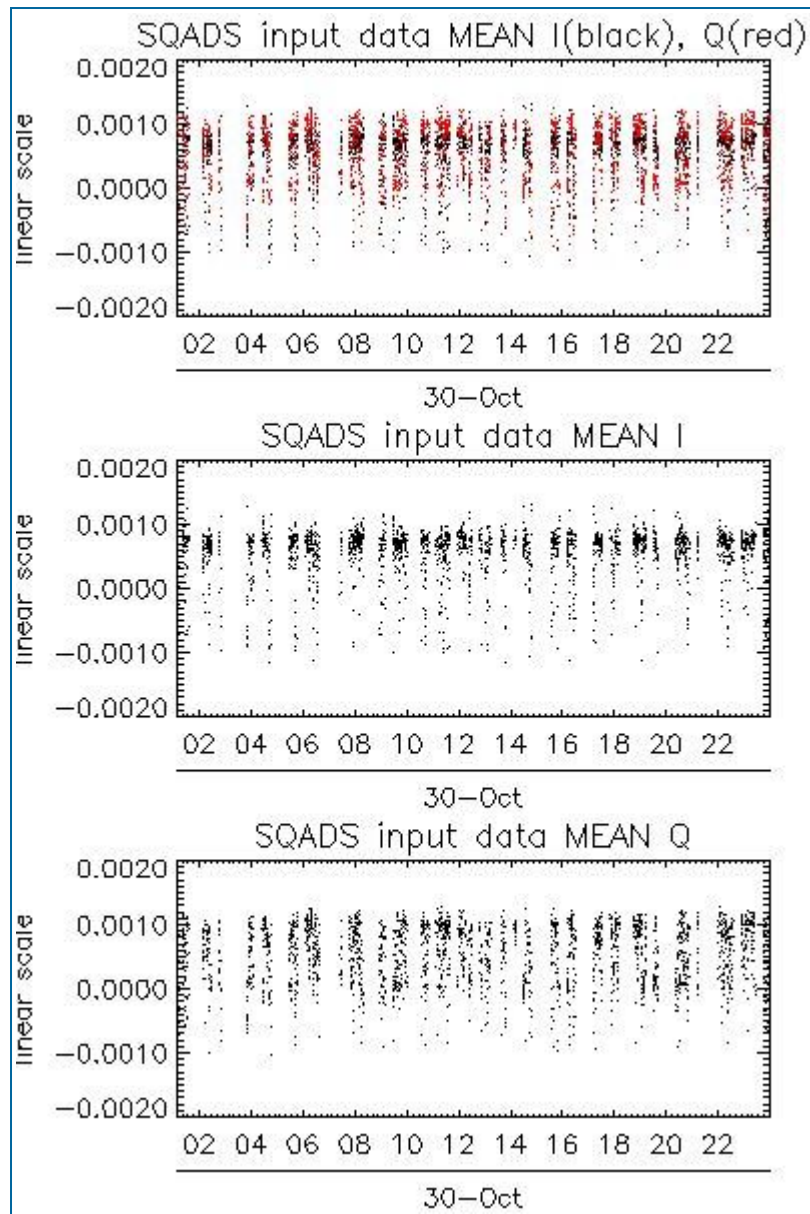


Channel	Statistics	DSS-B
MEAN I	mean	0.000546558
	stdev	1.66513e-07
MEAN Q	mean	0.000527079
	stdev	2.18328e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.137554
	stdev	0.00100340
STDEV Q	mean	0.137949
	stdev	0.00101901

## 7.2 - Analysis for IMM

[ [BACK TO MENU](#) ]



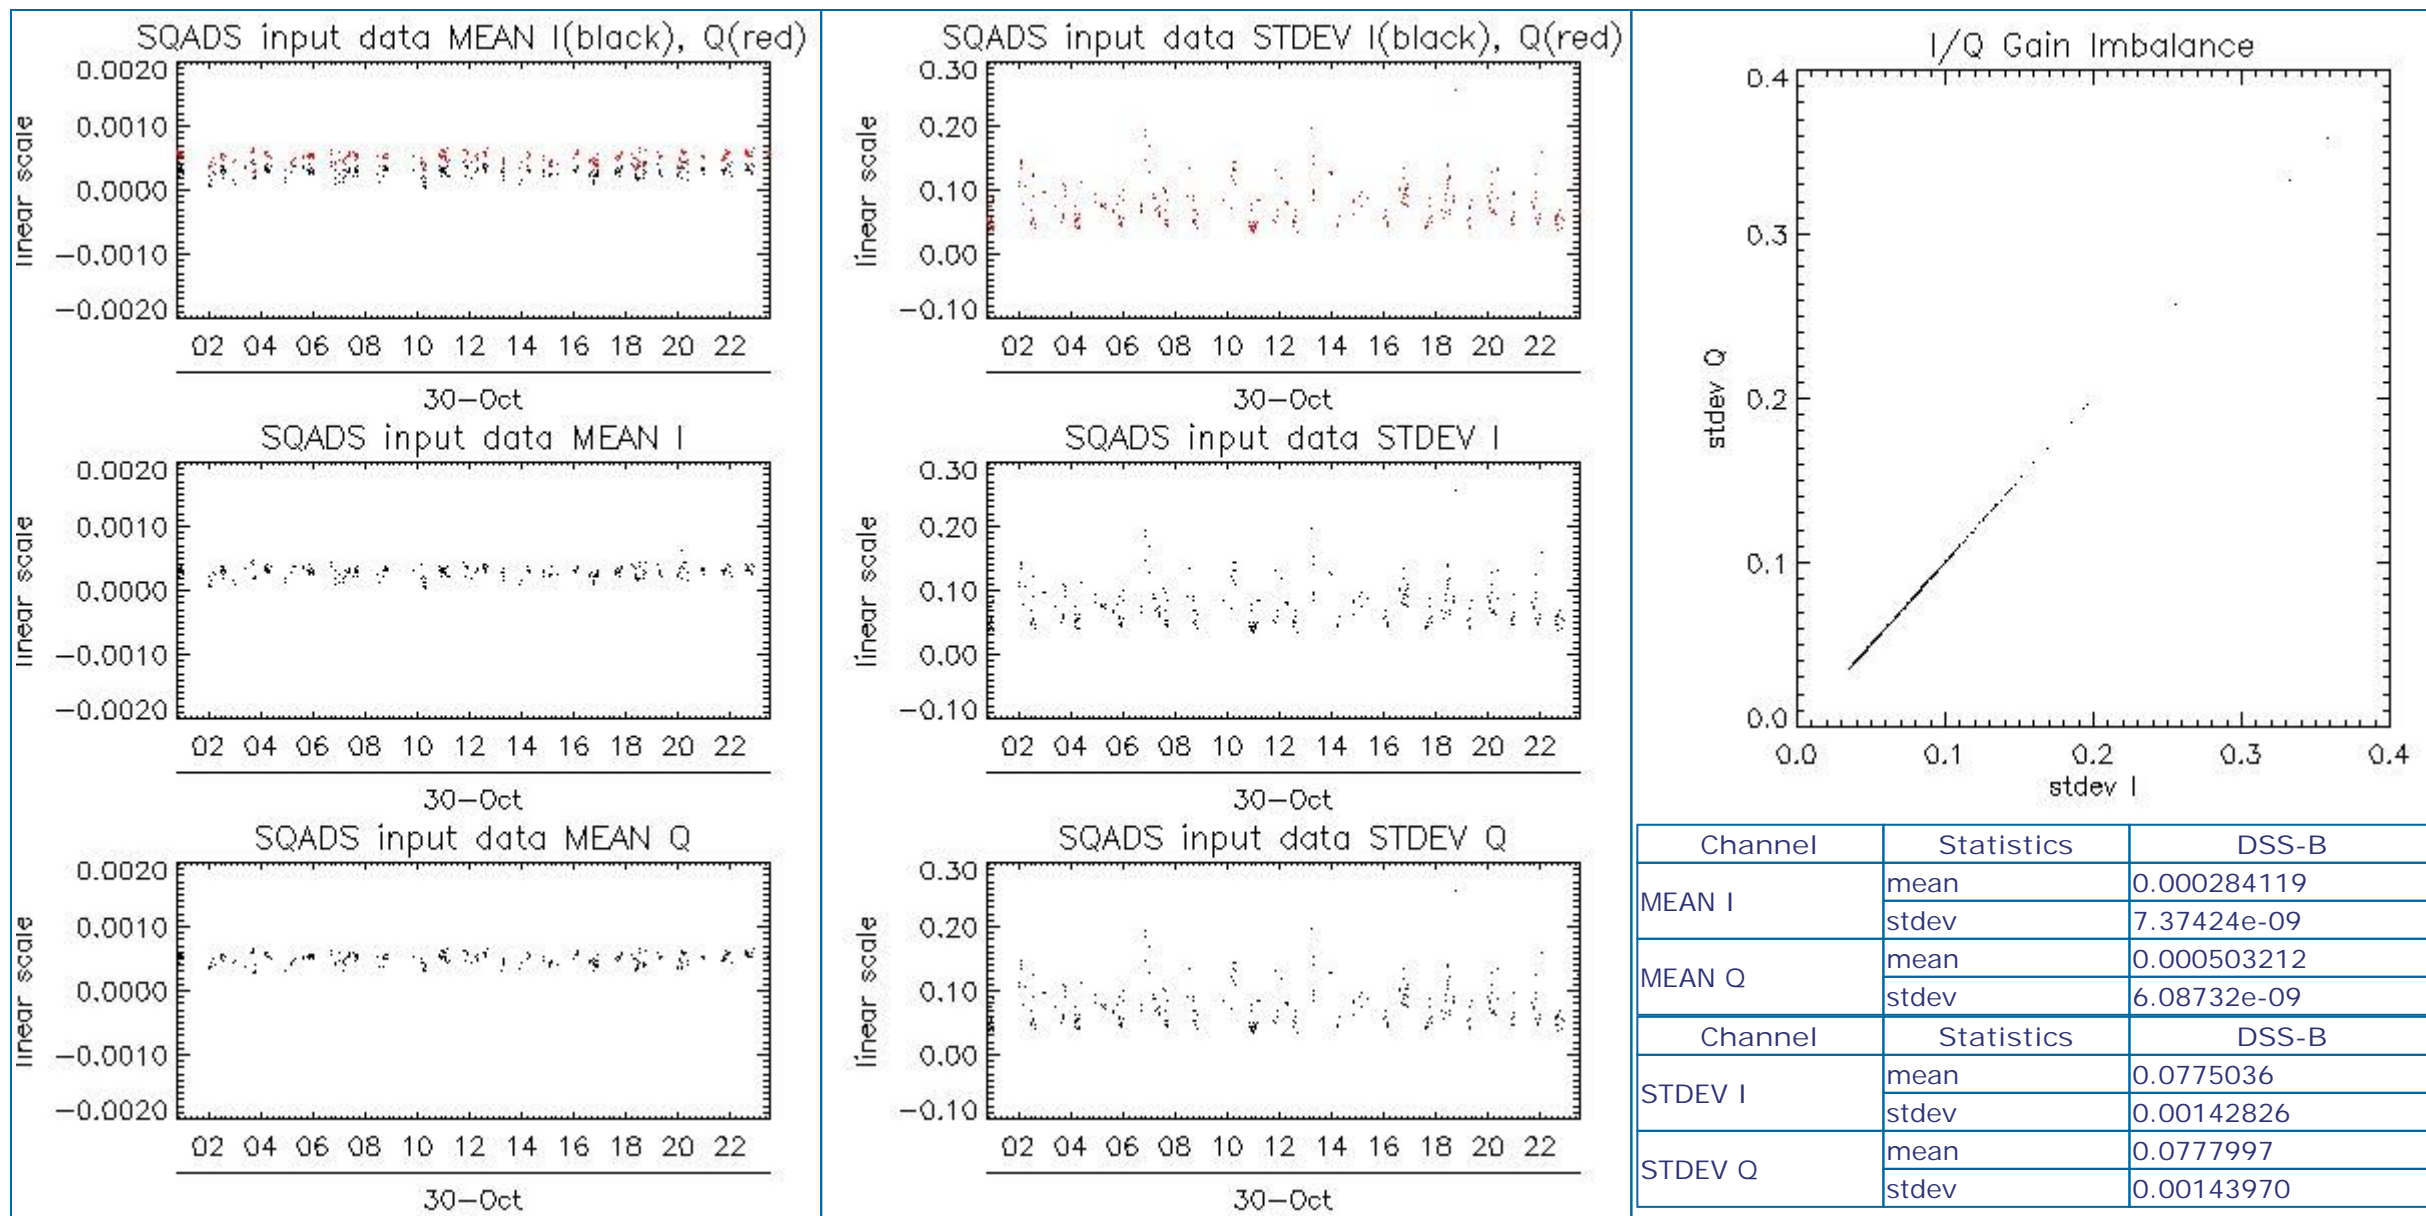



## 8 - TELEMETRY ANALYSIS

Processing Center	Product	Gaps	Missing lines
PDE	ASA_WSM_1PNPDE20071030_144858_000001282063_00011_29624_7745.N1	0	25
PDE	ASA_WSM_1PNPDE20071030_144858_000001842063_00011_29624_7821.N1	0	25
PDE	ASA_WSM_1PNPDE20071030_144858_000001842063_00011_29624_7876.N1	0	25
PDK	ASA_WSM_1PNPDK20071030_095007_000000672063_00008_29621_3358.N1	0	40

### 8.1 - Number of Missing lines


[ BACK TO MENU ]



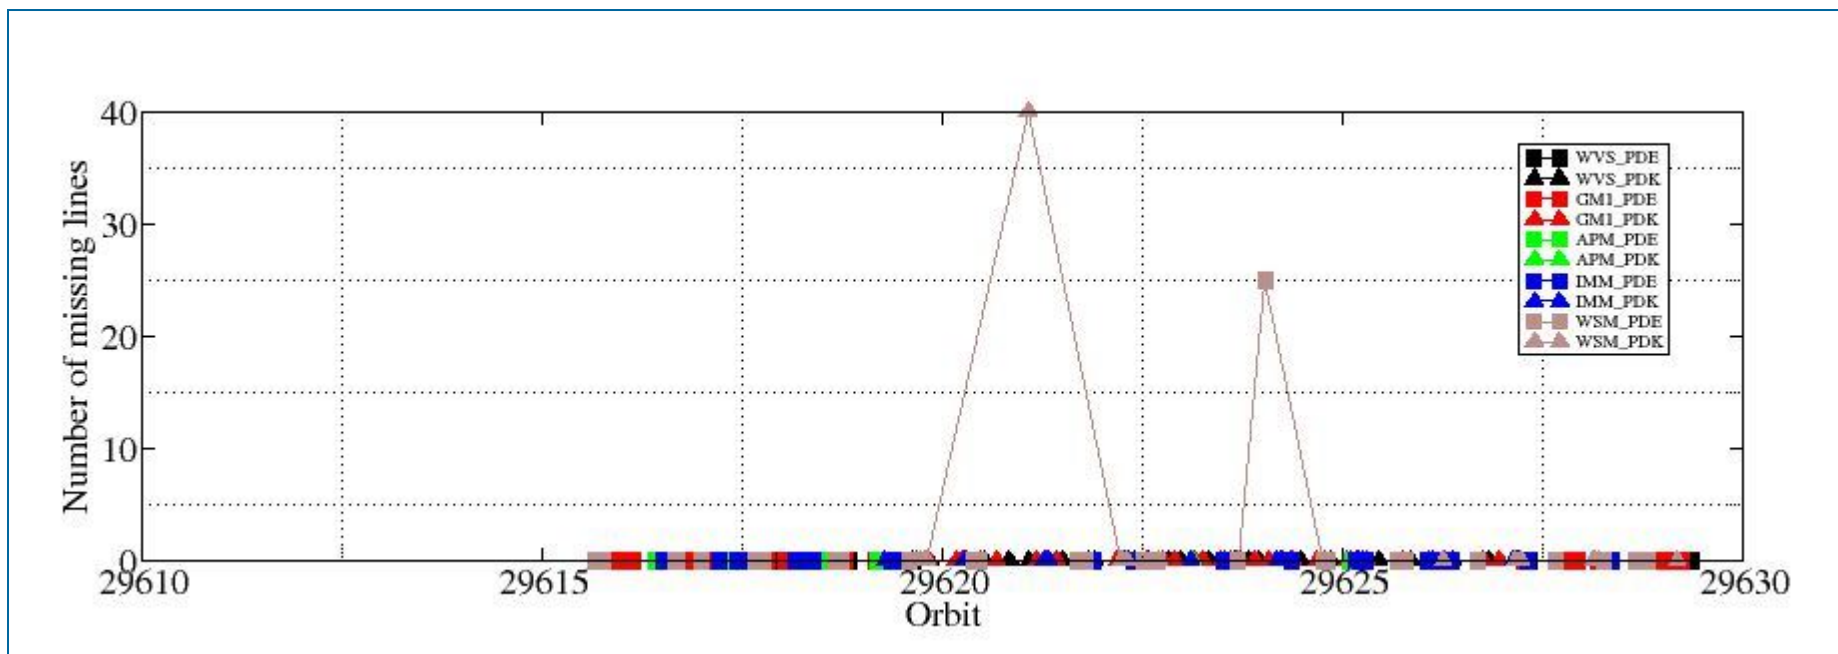

## 8.2 - Number of Gaps

[ [BACK TO MENU](#) ]

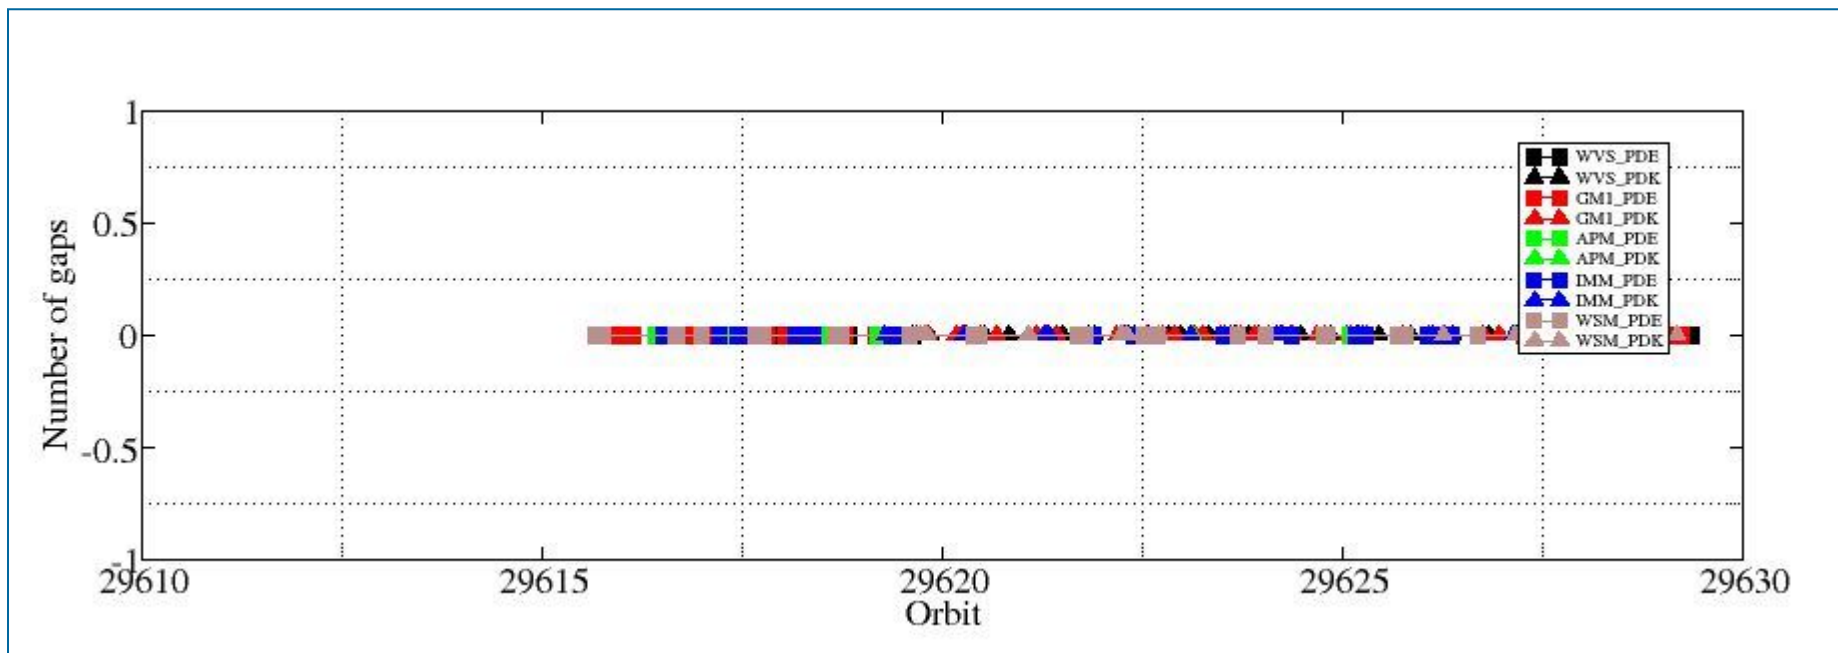

#####  
ASAR DAILY REPORT for 071030  
#####

MODE: DAILY  
ANALYSIS: ALL  
DATE: YESTERDAY

Analysis will be performed from 2007-10-30 00:00:00 to 2007-10-30 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/071030/

DATA SUMMARY  
#####  
Summary will be performed from 2007-10-30 00:00:00 to 2007-10-30 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/071030/DATA\_SUMMARY

Creating directory ./RESULTS/DAILY/071030/DATA\_SUMMARY...  
Writing file ./RESULTS/DAILY/071030/DATA\_SUMMARY/Data\_summary.html...

\*\*\*\*\*  
Getting WVS products list from 2007-10-30 00:00:00 to 2007-10-30 23:59:59...  
Writing file ./RESULTS/DAILY/071030/DATA\_SUMMARY/List\_WVS\_products\_used.xls...  
Writing file ./RESULTS/DAILY/071030/DATA\_SUMMARY/List\_WVS\_products\_used.txt...

\*\*\*\*\*  
Getting GM1 products list from 2007-10-30 00:00:00 to 2007-10-30 23:59:59...  
Writing file ./RESULTS/DAILY/071030/DATA\_SUMMARY/List\_GM1\_products\_used.xls...  
Writing file ./RESULTS/DAILY/071030/DATA\_SUMMARY/List\_GM1\_products\_used.txt...

\*\*\*\*\*  
Getting APM products list from 2007-10-30 00:00:00 to 2007-10-30 23:59:59...  
Writing file ./RESULTS/DAILY/071030/DATA\_SUMMARY/List\_APM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/071030/DATA\_SUMMARY/List\_APM\_products\_used.txt...

\*\*\*\*\*  
Getting IMM products list from 2007-10-30 00:00:00 to 2007-10-30 23:59:59...  
Writing file ./RESULTS/DAILY/071030/DATA\_SUMMARY/List\_IMM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/071030/DATA\_SUMMARY/List\_IMM\_products\_used.txt...

\*\*\*\*\*  
Getting WSM products list from 2007-10-30 00:00:00 to 2007-10-30 23:59:59...  
Writing file ./RESULTS/DAILY/071030/DATA\_SUMMARY/List\_WSM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/071030/DATA\_SUMMARY/List\_WSM\_products\_used.txt...

\*\*\*\*\*  
Getting MS products list from 2007-10-30 00:00:00 to 2007-10-30 23:59:59...  
Writing file ./RESULTS/DAILY/071030/DATA\_SUMMARY/List\_MS\_products\_used.xls...  
Writing file ./RESULTS/DAILY/071030/DATA\_SUMMARY/List\_MS\_products\_used.txt...

DATA SUMMARY completed  
#####

AUXILIARY FILES ANALYSIS  
#####  
Analysis will be performed from 2007-10-30 00:00:00 to 2007-10-30 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/071030/AUXILIARY

Creating directory ./RESULTS/DAILY/071030/AUXILIARY...

\*\*\*\*\*  
Looking for the IECF operational ADFs list...



Found list 20071030\_030001\_current\_3\_IECF\_ADFs.txt...  
Extracting ADFs...

ASA\_CON\_AXVIEC20070410\_140202\_20070204\_165113\_20071231\_000000  
ASA\_INS\_AXVIEC20070306\_164819\_20070307\_060000\_20071231\_000000  
ASA\_XCH\_AXVIEC20051219\_162547\_20020301\_000000\_20081231\_000000  
ASA\_XCA\_AXVIEC20070517\_153558\_20070204\_165113\_20071231\_000000

Writing file ./RESULTS/DAILY/071030/AUXILIARY/ASAR\_ADFs\_IECF\_List3.html...  
Writing file ./RESULTS/DAILY/071030/AUXILIARY/Auxiliary\_files\_summary.html...

\*\*\*\*\*  
Analysing WVS products...

Writing file ./RESULTS/DAILY/071030/AUXILIARY/Check\_ADFs\_WVS.xls...  
Writing file ./RESULTS/DAILY/071030/AUXILIARY/Check\_ADFs\_WVS.txt...

ASA_WVS_1PNPDE20071030_010800_000003152063_00002_29615_5919.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_010800_000003152063_00002_29615_6201.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_010800_000003152063_00002_29615_7009.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_010800_000003152063_00002_29615_7240.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_012046_000008092063_00003_29616_6213.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_012046_000008092063_00003_29616_6469.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_012046_000008092063_00003_29616_6980.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_012046_000008092063_00003_29616_7243.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_020605_000002692063_00003_29616_6204.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_020605_000002692063_00003_29616_6463.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_020605_000002692063_00003_29616_6977.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_020605_000002692063_00003_29616_7177.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_021347_000003902063_00003_29616_6198.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_021347_000003902063_00003_29616_6224.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_021347_000003902063_00003_29616_6466.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_021347_000003902063_00003_29616_7172.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_021947_000004652063_00003_29616_6304.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_021947_000004652063_00003_29616_6432.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_021947_000004652063_00003_29616_6653.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_021947_000004652063_00003_29616_6670.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_024415_000002852063_00003_29616_6429.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_024415_000002852063_00003_29616_6503.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_024415_000002852063_00003_29616_6650.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_024415_000002852063_00003_29616_7060.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_034907_000007492063_00004_29617_6574.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_034907_000007492063_00004_29617_7063.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_040107_000001642063_00004_29617_5826.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_040107_000001642063_00004_29617_5833.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_042451_000012292063_00004_29617_5630.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_052629_000006592063_00005_29618_5613.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_053854_000001942063_00005_29618_5591.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_054154_000003602063_00005_29618_5499.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_060527_000019192063_00005_29618_5484.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_072510_000000302063_00006_29619_6192.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_072510_000000302063_00006_29619_6195.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_072510_000000302063_00006_29619_7246.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_072510_000000302063_00006_29619_7265.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_202053_000019492063_00014_29627_7517.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_202053_000019492063_00014_29627_7671.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_211050_000001952063_00014_29627_7510.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_211050_000001952063_00014_29627_7662.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_211305_000001052063_00014_29627_7879.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_211305_000001052063_00014_29627_7967.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_220016_000001352063_00015_29628_7772.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_220411_000018292063_00015_29628_7884.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_220411_000018292063_00015_29628_7972.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_225244_000001952063_00015_29628_7887.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_225244_000001952063_00015_29628_7975.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_225459_000008992063_00015_29628_8104.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

ASA_WVS_1PNPDE20071030_231431_000006742063_00016_29629_8107.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20071030_234439_000009892063_00016_29629_8129.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_072510_000001952063_00006_29619_3171.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_074603_0000019492063_00006_29619_3220.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_085544_000008392063_00007_29620_3263.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_092639_000013642063_00007_29620_3266.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_095127_000005242063_00008_29621_3278.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_103237_000010642063_00008_29621_3390.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_110716_000002102063_00008_29621_3393.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_111310_000016192063_00008_29621_3400.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_115748_000003002063_00009_29622_3509.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_120421_000006292063_00009_29622_3514.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_122142_000005552063_00009_29622_3521.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_124750_000003152063_00009_29622_3524.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_130134_000007342063_00009_29622_3529.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_133830_000005842063_00010_29623_3664.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_140838_000001802063_00010_29623_3777.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_142826_000003902063_00010_29623_3780.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_143937_000004792063_00010_29623_3785.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_153308_000011392063_00011_29624_3811.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_160930_000012292063_00011_29624_3825.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_171018_000013492063_00012_29625_3942.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_175057_000012142063_00012_29625_3947.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_184428_000017392063_00013_29626_4064.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20071030_193014_000007052063_00013_29626_4074.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

\*\*\*\*\*

Analysing GM1 products...

Writing file ./RESULTS/DAILY/071030/AUXILIARY/Check\_ADFs\_GM1.xls...

Writing file ./RESULTS/DAILY/071030/AUXILIARY/Check\_ADFs\_GM1.txt...

ASA_GM1_1PNPDE20071030_011409_000003862063_00002_29615_5921.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_011409_000003862063_00002_29615_6206.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_011409_000003862063_00002_29615_7011.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_011409_000003862063_00002_29615_7237.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_013505_000014672063_00003_29616_6221.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_013505_000014672063_00003_29616_6665.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_013505_000014672063_00003_29616_7147.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_013505_000014672063_00003_29616_7414.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_023827_000003442063_00003_29616_6299.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_023827_000003442063_00003_29616_6562.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_023827_000003442063_00003_29616_6647.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_023827_000003442063_00003_29616_6784.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_024947_000001022063_00003_29616_6297.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_024947_000001022063_00003_29616_6511.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_024947_000001022063_00003_29616_6641.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_024947_000001022063_00003_29616_6778.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_025140_000003922063_00003_29616_6293.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_025140_000003922063_00003_29616_6645.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_025140_000003922063_00003_29616_6667.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_025140_000003922063_00003_29616_6782.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_025957_000002472063_00003_29616_6295.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_025957_000002472063_00003_29616_6505.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_025957_000002472063_00003_29616_6643.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_025957_000002472063_00003_29616_6780.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_031151_000006042063_00004_29617_6301.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_031151_000006042063_00004_29617_6507.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_032252_000010022063_00004_29617_6630.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_032252_000010022063_00004_29617_7163.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_034229_000001142063_00004_29617_6569.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_034229_000001142063_00004_29617_7057.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_042203_000001692063_00004_29617_5823.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_044616_000006642063_00005_29618_5821.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_045844_000007492063_00005_29618_5632.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20071030_051349_000003502063_00005_29618_5622.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK







ASA_IMM_1PNPDE20071030_181908_000000502063_00013_29626_7326.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20071030_181908_000000502063_00013_29626_7447.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20071030_183945_000001402063_00013_29626_7747.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20071030_183945_000001402063_00013_29626_7900.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20071030_184308_000000742063_00013_29626_7749.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20071030_184308_000000742063_00013_29626_7902.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20071030_201830_000001362063_00014_29627_8045.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20071030_201830_000001362063_00014_29627_8063.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20071030_220311_000000542063_00015_29628_8049.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20071030_220311_000000542063_00015_29628_8065.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_065046_000001422063_00006_29619_3140.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_082937_000001212063_00007_29620_3234.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_100958_000002002063_00008_29621_3360.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_101558_000002772063_00008_29621_3376.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_101700_000002152063_00008_29621_3372.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_115104_000000512063_00009_29622_3479.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_131449_000000362063_00010_29623_3604.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_150413_000001402063_00011_29624_3766.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_150759_000000812063_00011_29624_3764.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_164346_000000992063_00012_29625_3903.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_164535_000002622063_00012_29625_3923.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_165127_000000902063_00012_29625_3921.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_182024_000005942063_00013_29626_4057.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_195957_000001122063_00014_29627_4160.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_200547_000000372063_00014_29627_4146.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20071030_200628_000001612063_00014_29627_4168.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

\*\*\*\*\*

Analysing WSM products...

Writing file ./RESULTS/DAILY/071030/AUXILIARY/Check\_ADFs\_WSM.xls...

Writing file ./RESULTS/DAILY/071030/AUXILIARY/Check\_ADFs\_WSM.txt...

ASA_WSM_1PNPDE20071030_004726_000005432063_00002_29615_4869.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_004726_000005432063_00002_29615_7048.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_004726_000005432063_00002_29615_7161.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_005717_000003542063_00002_29615_6069.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_005717_000003542063_00002_29615_6289.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_005717_000003542063_00002_29615_6680.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_005717_000003542063_00002_29615_6776.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_022816_000005992063_00003_29616_6093.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_022816_000005992063_00003_29616_6131.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_022816_000005992063_00003_29616_7301.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_025823_000000852063_00003_29616_6031.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_025823_000000852063_00003_29616_6071.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_025823_000000852063_00003_29616_6768.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_025823_000000852063_00003_29616_7467.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_040807_000004462063_00004_29617_6160.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_040807_000004462063_00004_29617_7165.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_041629_000003242063_00004_29617_5955.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_041629_000003242063_00004_29617_7491.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_054843_000003042063_00005_29618_6033.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_055528_000003612063_00005_29618_5747.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_072147_000002012063_00006_29619_5697.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_084052_000004832063_00007_29620_6189.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_084052_000005632063_00007_29620_6485.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_084052_000005632063_00007_29620_6487.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_084052_000005632063_00007_29620_7021.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_084159_000004962063_00007_29620_6187.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_084957_000000182063_00007_29620_6091.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_105115_000004842063_00008_29621_6287.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_105846_000001522063_00008_29621_6314.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_110152_000003242063_00008_29621_6346.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_121535_000002082063_00009_29622_6426.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_123151_000000982063_00009_29622_6497.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_141413_000002022063_00010_29623_7512.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

ASA_WSM_1PNPDE20071030_141413_000002022063_00010_29623_7819.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_144858_000001282063_00011_29624_7745.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_144858_000001842063_00011_29624_7821.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_144858_000001842063_00011_29624_7876.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_160040_000000852063_00011_29624_7469.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_160040_000000852063_00011_29624_7485.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_160540_000002322063_00011_29624_7664.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_160540_000002322063_00011_29624_7825.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_173540_000002812063_00012_29625_7759.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_173540_000002812063_00012_29625_8047.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_174516_000003422063_00012_29625_7757.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_174516_000003422063_00012_29625_7904.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_191416_000003972063_00013_29626_7806.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_191416_000003972063_00013_29626_8067.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_205407_000004282063_00014_29627_8121.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_205407_000004282063_00014_29627_8217.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_215458_000002082063_00015_29628_8240.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_215458_000002082063_00015_29628_8246.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_223527_000002812063_00015_29628_8242.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_223527_000002812063_00015_29628_8275.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_224027_000001832063_00015_29628_8225.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_224027_000001832063_00015_29628_8233.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_224849_000002392063_00015_29628_8235.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20071030_224849_000002392063_00015_29628_8266.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_073404_000002982063_00006_29619_3356.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_073511_000002322063_00006_29619_3254.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_074041_000002132063_00006_29619_3354.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_074148_000001452063_00006_29619_3249.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_095007_000000672063_00008_29621_3358.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_114719_000000862063_00009_29622_3489.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_114827_000000182063_00009_29622_3411.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_115417_000002132063_00009_29622_3504.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_123351_000003612063_00009_29622_3905.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_123459_000002922063_00009_29622_3643.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_183054_000001232063_00013_29626_4052.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_200232_000001702063_00014_29627_4173.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_201006_000001412063_00014_29627_4175.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_214123_000000852063_00015_29628_4199.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_214354_000000852063_00015_29628_4201.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_214820_000002452063_00015_29628_4203.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20071030_232631_000002812063_00016_29629_4215.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

AUXILIARY FILES ANALYSIS completed

#####

MODULE STEPPING ANALYSIS

#####

Analysis will be performed from 2007-10-30 00:00:00 to 2007-10-30 23:59:59

Results will be exported to the directory: ./RESULTS/DAILY/071030/MODULE\_STEPPING

Creating directory ./RESULTS/DAILY/071030/MODULE\_STEPPING...

Creating directory ./RESULTS/DAILY/071030/MODULE\_STEPPING/FIRST\_REFERENCE...

Creating directory ./RESULTS/DAILY/071030/MODULE\_STEPPING/SECOND\_REFERENCE...

Creating directory ./RESULTS/DAILY/071030/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE...

Deleting old files...

\*\*\*\*\*  
\*\*\*\*\*

Creating images comparing with second reference...

Exporting results to the directory ../../RESULTS/DAILY/071030/MODULE\_STEPPING/SECOND\_REFERENCE...

Polarization: H

Reference product: ASA\_MS\_0PNPDK20050922\_062651\_000000152041\_00034\_18625\_0041.N1



Test product: ASA\_MS\_\_0PNPDK20071030\_173332\_000000162063\_00012\_29625\_0403.N1  
 H  
 H  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/SECOND\_REFERENCE/TGH\_20071030\_173332-20050922\_062651.png  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/SECOND\_REFERENCE/TPH\_20071030\_173332-20050922\_062651.png  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/SECOND\_REFERENCE/RGH\_20071030\_173332-20050922\_062651.png  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/SECOND\_REFERENCE/RPH\_20071030\_173332-20050922\_062651.png

Polarization: V  
 Reference product: ASA\_MS\_\_0PNPDK20050923\_055514\_000000152041\_00048\_18639\_0042.N1  
 Test product: ASA\_MS\_\_0PNPDK20071029\_180509\_000000162062\_00499\_29611\_0402.N1

V  
 V  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/SECOND\_REFERENCE/TGV\_20071029\_180509-20050923\_055514.png  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/SECOND\_REFERENCE/TPV\_20071029\_180509-20050923\_055514.png  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/SECOND\_REFERENCE/RGV\_20071029\_180509-20050923\_055514.png  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/SECOND\_REFERENCE/RPV\_20071029\_180509-20050923\_055514.png

\*\*\*\*\*  
 \*\*\*\*\*

Creating images comparing with previous product reference...  
 Exporting results to the directory ../../RESULTS/DAILY/071030/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE...

Polarization: H  
 Reference product: ASA\_MS\_\_0PNPDK20071028\_183646\_000000162062\_00485\_29597\_0401.N1  
 Test product: ASA\_MS\_\_0PNPDK20071030\_173332\_000000162063\_00012\_29625\_0403.N1

H  
 H  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TGH\_20071030\_173332-20071028\_183646.png  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TPH\_20071030\_173332-20071028\_183646.png  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RGH\_20071030\_173332-20071028\_183646.png  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RPH\_20071030\_173332-20071028\_183646.png

Polarization: V  
 Reference product: ASA\_MS\_\_0PNPDE20071027\_204859\_000000162062\_00472\_29584\_0230.N1  
 Test product: ASA\_MS\_\_0PNPDK20071029\_180509\_000000162062\_00499\_29611\_0402.N1

V  
 V  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TGV\_20071029\_180509-20071027\_204859.png  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TPV\_20071029\_180509-20071027\_204859.png  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RGV\_20071029\_180509-20071027\_204859.png  
 ../../RESULTS/DAILY/071030/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RPV\_20071029\_180509-20071027\_204859.png

MODULE\_STEPPING ANALYSIS completed  
 #####

CALIBRATION PULSES ANALYSIS  
 #####  
 Creating directory ./RESULTS/DAILY/071030/CALIBRATION\_PULSES...

\*\*\*\*\*  
 \*\*\*\*\*  
 ALL ROWS Analysis will be performed from 2007-10-30 00:00:00 to 2007-10-30 23:59:59

Analysing products WVS IS2 V/V  
 Writing image ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Calibration\_pulses\_all\_rows\_WVS\_IS2\_VV.png...  
 Analysing products GM1 SS3 H/H  
 Writing image ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Calibration\_pulses\_all\_rows\_GM1\_SS3\_HH.png...

\*\*\*\*\*  
 \*\*\*\*\*  
 TEMPORAL EVOLUTION Analysis will be performed from 2007-10-30 00:00:00 to 2007-10-30 23:59:59

Analysing products WVS IS2 V/V

Getting calibration pulses data for WVS IS2 V/V from 2007-10-30 00:00:00 to 2007-10-30 23:59:59. Rows: 1/5/9/13/17/21/25/29  
Writing file ./RESULTS/DAILY/071030/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2007-10-30\_1.dat...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_1.png...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2007-10-30 00:00:00 to 2007-10-30 23:59:59. Rows: 2/6/10/14/18/22/26/30  
Writing file ./RESULTS/DAILY/071030/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2007-10-30\_2.dat...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_2.png...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2007-10-30 00:00:00 to 2007-10-30 23:59:59. Rows: 3/7/11/15/19/23/27/31  
Writing file ./RESULTS/DAILY/071030/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2007-10-30\_3.dat...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_3.png...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2007-10-30 00:00:00 to 2007-10-30 23:59:59. Rows: 4/8/12/16/20/24/28/32  
Writing file ./RESULTS/DAILY/071030/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2007-10-30\_4.dat...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_4.png...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_4.png...

Analysing products GM1 SS3 H/H

Getting calibration pulses data for GM1 SS3 H/H from 2007-10-30 00:00:00 to 2007-10-30 23:59:59. Rows: 1/5/9/13/17/21/25/29  
Writing file ./RESULTS/DAILY/071030/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2007-10-30\_1.dat...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_1.png...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_1.png...

Getting calibration pulses data for GM1 SS3 H/H from 2007-10-30 00:00:00 to 2007-10-30 23:59:59. Rows: 2/6/10/14/18/22/26/30  
Writing file ./RESULTS/DAILY/071030/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2007-10-30\_2.dat...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_2.png...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2007-10-30 00:00:00 to 2007-10-30 23:59:59. Rows: 3/7/11/15/19/23/27/31  
Writing file ./RESULTS/DAILY/071030/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2007-10-30\_3.dat...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_3.png...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2007-10-30 00:00:00 to 2007-10-30 23:59:59. Rows: 4/8/12/16/20/24/28/32  
Writing file ./RESULTS/DAILY/071030/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2007-10-30\_4.dat...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_4.png...  
Writing ../../RESULTS/DAILY/071030//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_4.png...

CALIBRATION PULSES ANALYSIS completed

#####

DOPPLER ANALYSIS

#####

Creating directory ./RESULTS/DAILY/071030/DOPPLER...

\*\*\*\*\*

\*\*\*\*\*

DOPPLER ANX Analysis will be performed from 2007-10-30 00:00:00 to 2007-10-30 23:59:59

Analysing products WVS IS2 V/V

Getting doppler data for WVS IS2 V/V from 2007-10-30 00:00:00 to 2007-10-30 23:59:59...  
Writing file ./RESULTS/DAILY/071030/DOPPLER/Doppler\_data\_WVS\_IS2\_VV\_2007-10-30.dat...  
Running IDL program...  
Writing file ../../RESULTS/DAILY/071030/DOPPLER/DOPPLER\_ANX\_WVS\_IS2\_VV.png...

Analysing products GM1 SS1 H/H  
Getting doppler data for GM1 SS1 H/H from 2007-10-30 00:00:00 to 2007-10-30 23:59:59...  
Writing file ./RESULTS/DAILY/071030/DOPPLER/Doppler\_data\_GM1\_SS1\_HH\_2007-10-30.dat...  
Running IDL program...  
Writing file ../../RESULTS/DAILY/071030/DOPPLER/DOPPLER\_ANX\_GM1\_SS1\_HH.png...

\*\*\*\*\*  
\*\*\*\*\*  
DOPPLER JUMPS Analysis will be performed on WSM products from 2007-10-30 00:00:00 to 2007-10-30 23:59:59

Analysing by default products WSM  
Getting doppler jumps data for WSM from 2007-10-30 00:00:00 to 2007-10-30 23:59:59...  
Writing file ./RESULTS/DAILY/071030/DOPPLER/Doppler\_Jumps\_data\_WSM\_2007-10-30.dat...  
Running IDL program...  
Writing file ../../RESULTS/DAILY/071030/DOPPLER/DOPPLER\_JUMPS\_ANX\_WSM.png...  
Writing file ../../RESULTS/DAILY/071030/DOPPLER/DOPPLER\_JUMPS\_Date\_WSM.png...

\*\*\*\*\*  
\*\*\*\*\*  
DOPPLER MAP Analysis will be performed from 2007-10-30 00:00:00 to 2007-10-30 23:59:59

Analysing products WVS IS2 V/V  
Loading predicted doppler values....  
Phase: descending  
Found data...  
Computing mean error doppler estimated-predicted...  
Mean error = -18.072414 Hz  
Writing file ../../RESULTS/DAILY/071030//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_WVS\_IS2\_VV\_desc.jpg...  
Writing file ../../RESULTS/DAILY/071030//DOPPLER/DOPPLER\_Absolute\_WVS\_IS2\_VV\_desc.jpg...

\*\*\*\*\*  
Loading predicted doppler values....  
Phase: ascending  
Found data...  
Computing mean error doppler estimated-predicted...  
Mean error = -23.210992 Hz  
Writing file ../../RESULTS/DAILY/071030//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_WVS\_IS2\_VV\_asc.jpg...  
Writing file ../../RESULTS/DAILY/071030//DOPPLER/DOPPLER\_Absolute\_WVS\_IS2\_VV\_asc.jpg...

\*\*\*\*\*  
Analysing products GM1 SS1 H/H  
Loading predicted doppler values....  
Phase: descending  
Found data...  
Computing mean error doppler estimated-predicted...  
Mean error = -15.681482 Hz  
Writing file ../../RESULTS/DAILY/071030//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_GM1\_SS1\_HH\_desc.jpg...  
Writing file ../../RESULTS/DAILY/071030//DOPPLER/DOPPLER\_Absolute\_GM1\_SS1\_HH\_desc.jpg...

\*\*\*\*\*  
Loading predicted doppler values....  
Phase: ascending  
Found data...  
Computing mean error doppler estimated-predicted...  
Mean error = -21.561298 Hz  
Writing file ../../RESULTS/DAILY/071030//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_GM1\_SS1\_HH\_asc.jpg...  
Writing file ../../RESULTS/DAILY/071030//DOPPLER/DOPPLER\_Absolute\_GM1\_SS1\_HH\_asc.jpg...

\*\*\*\*\*

DOPPLER ANALYSIS completed

#####

CHIRP ANALYSIS

#####

Creating directory ./RESULTS/DAILY/071030/CHIRP...

\*\*\*\*\*  
\*\*\*\*\*

CHIRP Analysis will be performed from 2007-10-30 00:00:00 to 2007-10-30 23:59:59

Analysing products WSM SS1 H/H

\*\*\*\*\*

Getting ScaleFactor data for WSM SS1 H/H from 2007-10-30 00:00:00 to 2007-10-30 23:59:59...

Writing file ./RESULTS/DAILY/071030/CHIRP/ScaleFactor\_data\_WSM\_SS1\_HH\_2007-10-30.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/071030/CHIRP/ScaleFactor\_ANX\_WSM\_SS1\_HH.png...

Writing file ../../RESULTS/DAILY/071030/CHIRP/ScaleFactor\_DATE\_WSM\_SS1\_HH.png...

Analysing products WSM SS1 V/V

\*\*\*\*\*

Getting ScaleFactor data for WSM SS1 V/V from 2007-10-30 00:00:00 to 2007-10-30 23:59:59...

Writing file ./RESULTS/DAILY/071030/CHIRP/ScaleFactor\_data\_WSM\_SS1\_VV\_2007-10-30.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/071030/CHIRP/ScaleFactor\_ANX\_WSM\_SS1\_VV.png...

Writing file ../../RESULTS/DAILY/071030/CHIRP/ScaleFactor\_DATE\_WSM\_SS1\_VV.png...

CHIRP ANALYSIS completed

#####

RAW DATA ANALYSIS

#####

Analysis will be performed from 2007-10-30 00:00:00 to 2007-10-30 23:59:59

Results will be exported to the directory: ./RESULTS/DAILY/071030/RAW\_DATA

Creating directory ./RESULTS/DAILY/071030/RAW\_DATA...

\*\*\*\*\*

Getting raw data for WVS from 2007-10-30 00:00:00 to 2007-10-30 23:59:59...

Writing file ./RESULTS/DAILY/071030/RAW\_DATA/Raw\_data\_WVS\_2007-10-30.dat...

Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/071030/RAW\_DATA/Raw\_data\_WVS\_input\_mean.png...

Creating image ../../RESULTS/DAILY/071030/RAW\_DATA/Raw\_data\_WVS\_input\_stdev.png...

Creating image ../../RESULTS/DAILY/071030/RAW\_DATA/Raw\_data\_WVS\_gain\_imbalance.png...

\*\*\*\*\*

Getting raw data for IMM from 2007-10-30 00:00:00 to 2007-10-30 23:59:59...

Writing file ./RESULTS/DAILY/071030/RAW\_DATA/Raw\_data\_IMM\_2007-10-30.dat...

Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/071030/RAW\_DATA/Raw\_data\_IMM\_input\_mean.png...

Creating image ../../RESULTS/DAILY/071030/RAW\_DATA/Raw\_data\_IMM\_input\_stdev.png...

Creating image ../../RESULTS/DAILY/071030/RAW\_DATA/Raw\_data\_IMM\_gain\_imbalance.png...

RAW DATA ANALYSIS completed

#####

TELEMETRY ANALYSIS

#####  
Analysis will be performed from 2007-10-30 00:00:00 to 2007-10-30 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/071030/TELEMETRY

Creating directory ./RESULTS/DAILY/071030/TELEMETRY...

Looking for gaps and missing lines in WVS products...  
\*\*\*\*\*

Checking 51 products from PDE...  
Checking 23 products from PDK...

Looking for gaps and missing lines in GM1 products...  
\*\*\*\*\*

Checking 57 products from PDE...  
Checking 42 products from PDK...

Looking for gaps and missing lines in APM products...  
\*\*\*\*\*

Checking 18 products from PDE...  
Checking 2 products from PDK...

Looking for gaps and missing lines in IMM products...  
\*\*\*\*\*

Checking 43 products from PDE...  
Checking 16 products from PDK...

Looking for gaps and missing lines in WSM products...  
\*\*\*\*\*

Checking 57 products from PDE...  
Found product...ASA\_WSM\_1PNPDE20071030\_144858\_000001282063\_00011\_29624\_7745.N1 / 0 gaps / 25 missing lines  
Found product...ASA\_WSM\_1PNPDE20071030\_144858\_000001842063\_00011\_29624\_7821.N1 / 0 gaps / 25 missing lines  
Found product...ASA\_WSM\_1PNPDE20071030\_144858\_000001842063\_00011\_29624\_7876.N1 / 0 gaps / 25 missing lines  
Checking 17 products from PDK...  
Found product...ASA\_WSM\_1PNPDK20071030\_095007\_000000672063\_00008\_29621\_3358.N1 / 0 gaps / 40 missing lines

Creating graph of missing lines and gaps...  
\*\*\*\*\*

Creating image: ./RESULTS/DAILY/071030/TELEMETRY/TELEMETRY\_Missing\_lines.png...  
Creating image: ./RESULTS/DAILY/071030/TELEMETRY/TELEMETRY\_Gaps.png...

TELEMETRY ANALYSIS completed

#####

BROWSE PRODUCTS ANALYSIS

#####  
Analysis will be performed on 2007-10-30

\*\*\*\*\*

Scanning directory /nas3/ENVISAT/ASAR//ASA\_GM\_BP...  
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA\_GM\_BP/JPG/20071030/

Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_011409\_000003862063\_00002\_29615\_5922.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_011409\_000003862063\_00002\_29615\_6207.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_011409\_000003862063\_00002\_29615\_7012.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_011409\_000003862063\_00002\_29615\_7238.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_013505\_000014672063\_00003\_29616\_6222.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_013505\_000014672063\_00003\_29616\_6666.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_013505\_000014672063\_00003\_29616\_7148.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_013505\_000014672063\_00003\_29616\_7415.N1 ...

Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_023827\_000003442063\_00003\_29616\_6300.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_023827\_000003442063\_00003\_29616\_6563.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_023827\_000003442063\_00003\_29616\_6648.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_023827\_000003442063\_00003\_29616\_6785.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_024947\_000001022063\_00003\_29616\_6298.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_024947\_000001022063\_00003\_29616\_6512.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_024947\_000001022063\_00003\_29616\_6642.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_024947\_000001022063\_00003\_29616\_6779.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_025140\_000003922063\_00003\_29616\_6294.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_025140\_000003922063\_00003\_29616\_6646.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_025140\_000003922063\_00003\_29616\_6668.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_025140\_000003922063\_00003\_29616\_6783.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_025957\_000002472063\_00003\_29616\_6296.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_025957\_000002472063\_00003\_29616\_6506.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_025957\_000002472063\_00003\_29616\_6644.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_025957\_000002472063\_00003\_29616\_6781.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_031151\_000006042063\_00004\_29617\_6302.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_031151\_000006042063\_00004\_29617\_6508.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_032252\_000010022063\_00004\_29617\_6631.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_032252\_000010022063\_00004\_29617\_7164.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_034229\_000001142063\_00004\_29617\_6570.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_034229\_000001142063\_00004\_29617\_7058.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_042203\_000001692063\_00004\_29617\_5824.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_044616\_000006642063\_00005\_29618\_5822.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_045844\_000007492063\_00005\_29618\_5633.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_051349\_000003502063\_00005\_29618\_5623.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_052115\_000003142063\_00005\_29618\_5599.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_055402\_000000782063\_00005\_29618\_5497.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_060139\_000002232063\_00005\_29618\_5493.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_063810\_000002412063\_00006\_29619\_5491.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_064318\_000004472063\_00006\_29619\_5495.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_065325\_000003562063\_00006\_29619\_5487.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_070058\_000004592063\_00006\_29619\_5489.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_071112\_000001382063\_00006\_29619\_5482.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_071425\_000000962063\_00006\_29619\_5480.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20071030\_071738\_000002352063\_00006\_29619\_5478.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDK20071030\_183307\_000003982063\_00013\_29626\_4060.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDK20071030\_192105\_000005492063\_00013\_29626\_4062.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDK20071030\_194243\_000007672063\_00013\_29626\_4072.N1 ...

ANALYSIS COMPLETED: 47 GM browse products to see...

\*\*\*\*\*

\*\*\*\*\*

Scanning directory /nas3/ENVISAT/ASAR//ASA\_AP\_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA\_AP\_BP/JPG/20071030/

Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_020140\_000000862063\_00003\_29616\_6036.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_020140\_000000862063\_00003\_29616\_6640.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_020140\_000000862063\_00003\_29616\_7150.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_020140\_000000862063\_00003\_29616\_7407.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_020332\_000001462063\_00003\_29616\_6038.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_020332\_000001462063\_00003\_29616\_6638.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_020332\_000001462063\_00003\_29616\_7126.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_020332\_000001462063\_00003\_29616\_7365.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_021119\_000000562063\_00003\_29616\_5811.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_021119\_000000562063\_00003\_29616\_6435.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_021119\_000000562063\_00003\_29616\_6715.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_021119\_000000562063\_00003\_29616\_6961.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_033936\_000001462063\_00004\_29617\_6701.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_033936\_000001462063\_00004\_29617\_6761.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_053807\_000000402063\_00005\_29618\_5543.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_064210\_000000402063\_00006\_29619\_5412.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_163417\_000000402063\_00012\_29625\_7268.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20071030\_163417\_000000402063\_00012\_29625\_7428.N1 ...

ANALYSIS COMPLETED: 18 AP browse products to see...

\*\*\*\*\*



\*\*\*\*\*

Scanning directory /nas3/ENVISAT/ASAR//ASA\_IM\_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA\_IM\_BP/JPG/20071030/

Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_021305\_000000342063\_00003\_29616\_5809.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_021305\_000000342063\_00003\_29616\_6425.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_021305\_000000342063\_00003\_29616\_6461.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_021305\_000000342063\_00003\_29616\_6683.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_032157\_000000372063\_00004\_29617\_5936.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_032157\_000000372063\_00004\_29617\_7026.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_034422\_000000802063\_00004\_29617\_6375.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_034422\_000000802063\_00004\_29617\_6699.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_034739\_000000812063\_00004\_29617\_6349.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_034739\_000000812063\_00004\_29617\_6697.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_045721\_000000652063\_00005\_29618\_5721.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_051111\_000001402063\_00005\_29618\_5976.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_051111\_000001402063\_00005\_29618\_6496.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_051937\_000000802063\_00005\_29618\_6030.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_051937\_000000802063\_00005\_29618\_7405.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_065920\_000000802063\_00006\_29619\_5539.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_070834\_000001402063\_00006\_29619\_5537.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_071333\_000000352063\_00006\_29619\_5399.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_071602\_000000782063\_00006\_29619\_5541.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_111125\_000000982063\_00008\_29621\_6292.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_120324\_000000512063\_00009\_29622\_6138.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_135703\_000000732063\_00010\_29623\_7430.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_135703\_000000732063\_00010\_29623\_7779.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_152251\_000000362063\_00011\_29624\_7270.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_152251\_000000362063\_00011\_29624\_7421.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_164249\_000000802063\_00012\_29625\_7598.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_164249\_000000802063\_00012\_29625\_7824.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_165222\_000001132063\_00012\_29625\_7669.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_165222\_000001132063\_00012\_29625\_7869.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_165513\_000000372063\_00012\_29625\_7276.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_165513\_000000372063\_00012\_29625\_7438.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_181231\_000000402063\_00013\_29626\_7325.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_181231\_000000402063\_00013\_29626\_7458.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_181908\_000000502063\_00013\_29626\_7327.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_183945\_000001402063\_00013\_29626\_7748.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20071030\_184308\_000000742063\_00013\_29626\_7750.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDK20071030\_182024\_000005942063\_00013\_29626\_4058.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDK20071030\_195957\_000001122063\_00014\_29627\_4161.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDK20071030\_200547\_000000372063\_00014\_29627\_4147.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDK20071030\_200628\_000001612063\_00014\_29627\_4169.N1 ...

ANALYSIS COMPLETED: 40 IM browse products to see...

\*\*\*\*\*

\*\*\*\*\*

Scanning directory /nas3/ENVISAT/ASAR//ASA\_WS\_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA\_WS\_BP/JPG/20071030/

Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20071030\_004726\_000005432063\_00002\_29615\_7049.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20071030\_004726\_000005432063\_00002\_29615\_7162.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20071030\_005717\_000003542063\_00002\_29615\_6070.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20071030\_005717\_000003542063\_00002\_29615\_6290.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20071030\_005717\_000003542063\_00002\_29615\_6681.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20071030\_005717\_000003542063\_00002\_29615\_6777.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20071030\_022816\_000005992063\_00003\_29616\_6094.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20071030\_022816\_000005992063\_00003\_29616\_6132.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20071030\_022816\_000005992063\_00003\_29616\_7302.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20071030\_025823\_000000852063\_00003\_29616\_6032.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20071030\_025823\_000000852063\_00003\_29616\_6482.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20071030\_025823\_000000852063\_00003\_29616\_6769.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20071030\_025823\_000000852063\_00003\_29616\_7468.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20071030\_040807\_000004462063\_00004\_29617\_6161.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20071030\_040807\_000004462063\_00004\_29617\_7166.N1 ...



```

Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_041629_000003242063_00004_29617_5956.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_041629_000003242063_00004_29617_7492.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_054843_000003042063_00005_29618_6034.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_055528_000003612063_00005_29618_5748.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_072147_000002012063_00006_29619_5698.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_084052_000004832063_00007_29620_6190.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_084052_000005632063_00007_29620_6486.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_084052_000005632063_00007_29620_6488.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_084052_000005632063_00007_29620_7022.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_084159_000004962063_00007_29620_6188.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_084957_000000182063_00007_29620_6092.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_105115_000004842063_00008_29621_6288.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_105846_000001522063_00008_29621_6315.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_110152_000003242063_00008_29621_6347.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_121535_000002082063_00009_29622_6427.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_123151_000000982063_00009_29622_6498.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_141413_000002022063_00010_29623_7513.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_141413_000002022063_00010_29623_7820.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_144858_000001282063_00011_29624_7746.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_144858_000001842063_00011_29624_7822.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_144858_000001842063_00011_29624_7877.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_160040_000000852063_00011_29624_7470.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_160040_000000852063_00011_29624_7486.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_160540_000002322063_00011_29624_7665.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_160540_000002322063_00011_29624_7826.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_173540_000002812063_00012_29625_7760.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_174516_000003422063_00012_29625_7758.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20071030_191416_000003972063_00013_29626_7807.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDK20071030_183054_000001232063_00013_29626_4053.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDK20071030_200232_000001702063_00014_29627_4174.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDK20071030_201006_000001412063_00014_29627_4176.N1 ...

```

ANALYSIS COMPLETED: 46 WS browse products to see...

\*\*\*\*\*

BROWSE PRODUCTS ANALYSIS completed

#####

HTML REPORT generation

#####

Building file ./RESULTS/DAILY/071030/asarReport.html...

Building DATA SUMMARY section...

Building AUXILIARY FILES ANALYSIS section...

Building MODULE STEPPING ANALYSIS section...

Building CALIBRATION PULSES ANALYSIS section...

Building DOPPLER ANALYSIS section...

Building CHIRP ANALYSIS section...

Building RAW DATA ANALYSIS section...

Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed

#####



# ASAR Daily Report



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20071030_020140_000000862063_00003_29616_6035.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_020140_000000862063_00003_29616_6639.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_020140_000000862063_00003_29616_7149.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_020140_000000862063_00003_29616_7406.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_020332_000001462063_00003_29616_6037.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_020332_000001462063_00003_29616_6637.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_020332_000001462063_00003_29616_7125.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_020332_000001462063_00003_29616_7364.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_021119_000000562063_00003_29616_5810.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_021119_000000562063_00003_29616_6434.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_021119_000000562063_00003_29616_6714.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_021119_000000562063_00003_29616_6960.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_033936_000001462063_00004_29617_6700.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_033936_000001462063_00004_29617_6760.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_053807_000000402063_00005_29618_5542.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_064210_000000402063_00006_29619_5411.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_163417_000000402063_00012_29625_7267.N1		OK	OK	OK
ASA_APM_1PNPDE20071030_163417_000000402063_00012_29625_7427.N1		OK	OK	OK
ASA_APM_1PNPDK20071030_131602_000002522063_00010_29623_3645.N1		OK	OK	OK
ASA_APM_1PNPDK20071030_131704_000001902063_00010_29623_3628.N1		OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20071030_011409_000003862063_00002_29615_5921.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_011409_000003862063_00002_29615_6206.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_011409_000003862063_00002_29615_7011.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_011409_000003862063_00002_29615_7237.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_013505_000014672063_00003_29616_6221.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_013505_000014672063_00003_29616_6665.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_013505_000014672063_00003_29616_7147.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_013505_000014672063_00003_29616_7414.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_023827_000003442063_00003_29616_6299.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_023827_000003442063_00003_29616_6562.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_023827_000003442063_00003_29616_6647.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_023827_000003442063_00003_29616_6784.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_024947_000001022063_00003_29616_6297.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_024947_000001022063_00003_29616_6511.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_024947_000001022063_00003_29616_6641.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_024947_000001022063_00003_29616_6778.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_025140_000003922063_00003_29616_6293.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_025140_000003922063_00003_29616_6645.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_025140_000003922063_00003_29616_6667.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_025140_000003922063_00003_29616_6782.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_025957_000002472063_00003_29616_6295.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_025957_000002472063_00003_29616_6505.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_025957_000002472063_00003_29616_6643.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_025957_000002472063_00003_29616_6780.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_031151_000006042063_00004_29617_6301.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_031151_000006042063_00004_29617_6507.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_032252_000010022063_00004_29617_6630.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_032252_000010022063_00004_29617_7163.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_034229_000001142063_00004_29617_6569.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_034229_000001142063_00004_29617_7057.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_042203_000001692063_00004_29617_5823.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_044616_000006642063_00005_29618_5821.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_045844_000007492063_00005_29618_5632.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_051349_000003502063_00005_29618_5622.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_052115_000003142063_00005_29618_5598.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_055402_000000782063_00005_29618_5496.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_060139_000002232063_00005_29618_5492.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_063810_000002412063_00006_29619_5490.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_064318_000004472063_00006_29619_5494.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_065325_000003562063_00006_29619_5486.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_070058_000004592063_00006_29619_5488.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_071112_000001382063_00006_29619_5481.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_071425_000000962063_00006_29619_5479.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_071738_000002352063_00006_29619_5477.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_201239_000003502063_00014_29627_7507.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_201239_000003502063_00014_29627_7599.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_210125_000005612063_00014_29627_7514.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_210125_000005612063_00014_29627_7666.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_212117_000010082063_00014_29627_8119.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_214602_000001262063_00015_29628_7827.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_215236_000001322063_00015_29628_7780.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_215833_000001022063_00015_29628_7881.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_215833_000001022063_00015_29628_7969.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_224338_000003022063_00015_29628_7889.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_224338_000003022063_00015_29628_7977.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_231052_000002172063_00016_29629_8101.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20071030_233120_000007972063_00016_29629_8123.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_072910_000002832063_00006_29619_3168.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_073915_000000782063_00006_29619_3166.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_074428_000000902063_00006_29619_3173.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_081926_000006102063_00007_29620_3180.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_082826_000000722063_00007_29620_3256.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_083154_000005252063_00007_29620_3258.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_085027_000003142063_00007_29620_3260.N1					OK	OK	OK	OK

ASA_GM1_1PNPDK20071030_091040_000009242063_00007_29620_3268.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_100058_000005372063_00008_29621_3275.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_101335_000001442063_00008_29621_3387.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_102525_000004282063_00008_29621_3395.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_114057_000003742063_00009_29622_3397.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_114853_000001322063_00009_29622_3407.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_114958_000000662063_00009_29622_3506.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_115211_000001142063_00009_29622_3511.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_121912_000001502063_00009_29622_3516.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_124002_000004652063_00009_29622_3518.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_125357_000004532063_00009_29622_3526.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_132041_000006042063_00010_29623_3536.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_132933_000005312063_00010_29623_3655.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_135254_000002472063_00010_29623_3768.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_135836_000003622063_00010_29623_3770.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_140452_000002232063_00010_29623_3774.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_141228_000000962063_00010_29623_3772.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_141747_000006342063_00010_29623_3672.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_143540_000002352063_00010_29623_3782.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_145230_000007002063_00011_29624_3679.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_150650_000000662063_00011_29624_3686.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_150936_000004772063_00011_29624_3802.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_151918_000002112063_00011_29624_3804.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_152345_000001022063_00011_29624_3806.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_155304_000004472063_00011_29624_3808.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_160214_000001932063_00011_29624_3813.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_163048_000002052063_00012_29625_3815.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_163524_000004472063_00012_29625_3822.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_165013_000000722063_00012_29625_3937.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_165608_000008452063_00012_29625_3939.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_174029_000002772063_00012_29625_3944.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_181328_000003382063_00013_29626_3954.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_183307_000003982063_00013_29626_4059.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_192105_000005492063_00013_29626_4061.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20071030_194243_000007672063_00013_29626_4071.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_IMM_1PNPDE20071030_021305_000000342063_00003_29616_5808.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_021305_000000342063_00003_29616_6424.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_021305_000000342063_00003_29616_6460.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_021305_000000342063_00003_29616_6682.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_032157_000000372063_00004_29617_5935.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_032157_000000372063_00004_29617_7025.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_034422_000000802063_00004_29617_6374.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_034422_000000802063_00004_29617_6698.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_034739_000000812063_00004_29617_6348.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_034739_000000812063_00004_29617_6696.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_045721_000000652063_00005_29618_5720.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_051111_000001402063_00005_29618_5975.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_051111_000001402063_00005_29618_6495.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_051937_000000802063_00005_29618_6029.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_051937_000000802063_00005_29618_7404.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_065920_000000802063_00006_29619_5538.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_070834_000001402063_00006_29619_5536.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_071333_000000352063_00006_29619_5398.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_071602_000000782063_00006_29619_5540.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_111125_000000982063_00008_29621_6291.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_120324_000000512063_00009_29622_6137.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_135703_000000732063_00010_29623_7429.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_135703_000000732063_00010_29623_7778.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_152251_000000362063_00011_29624_7269.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_152251_000000362063_00011_29624_7420.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_164249_000000802063_00012_29625_7597.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_164249_000000802063_00012_29625_7823.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_165222_000001132063_00012_29625_7668.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_165222_000001132063_00012_29625_7868.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_165513_000000372063_00012_29625_7275.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_165513_000000372063_00012_29625_7437.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_181231_000000402063_00013_29626_7324.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_181231_000000402063_00013_29626_7457.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_181908_000000502063_00013_29626_7326.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_181908_000000502063_00013_29626_7447.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_183945_000001402063_00013_29626_7747.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_183945_000001402063_00013_29626_7900.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_184308_000000742063_00013_29626_7749.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_184308_000000742063_00013_29626_7902.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_201830_000001362063_00014_29627_8045.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_201830_000001362063_00014_29627_8063.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_220311_000000542063_00015_29628_8049.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20071030_220311_000000542063_00015_29628_8065.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_065046_000001422063_00006_29619_3140.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_082937_000001212063_00007_29620_3234.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_100958_000002002063_00008_29621_3360.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_101558_000002772063_00008_29621_3376.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_101700_000002152063_00008_29621_3372.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_115104_000000512063_00009_29622_3479.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_131449_000000362063_00010_29623_3604.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_150413_000001402063_00011_29624_3766.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_150759_000000812063_00011_29624_3764.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_164346_000000992063_00012_29625_3903.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_164535_000002622063_00012_29625_3923.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_165127_000000902063_00012_29625_3921.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_182024_000005942063_00013_29626_4057.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_195957_000001122063_00014_29627_4160.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_200547_000000372063_00014_29627_4146.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20071030_200628_000001612063_00014_29627_4168.N1					OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WSM_1PNPDE20071030_004726_000005432063_00002_29615_4869.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_004726_000005432063_00002_29615_7048.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_004726_000005432063_00002_29615_7161.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_005717_000003542063_00002_29615_6069.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_005717_000003542063_00002_29615_6289.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_005717_000003542063_00002_29615_6680.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_005717_000003542063_00002_29615_6776.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_022816_000005992063_00003_29616_6093.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_022816_000005992063_00003_29616_6131.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_022816_000005992063_00003_29616_7301.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_025823_000000852063_00003_29616_6031.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_025823_000000852063_00003_29616_6071.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_025823_000000852063_00003_29616_6768.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_025823_000000852063_00003_29616_7467.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_040807_000004462063_00004_29617_6160.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_040807_000004462063_00004_29617_7165.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_041629_000003242063_00004_29617_5955.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_041629_000003242063_00004_29617_7491.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_054843_000003042063_00005_29618_6033.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_055528_000003612063_00005_29618_5747.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_072147_000002012063_00006_29619_5697.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_084052_000004832063_00007_29620_6189.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_084052_000005632063_00007_29620_6485.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_084052_000005632063_00007_29620_6487.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_084052_000005632063_00007_29620_7021.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_084159_000004962063_00007_29620_6187.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_084957_000000182063_00007_29620_6091.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_105115_000004842063_00008_29621_6287.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_105846_000001522063_00008_29621_6314.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_110152_000003242063_00008_29621_6346.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_121535_000002082063_00009_29622_6426.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_123151_000000982063_00009_29622_6497.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_141413_000002022063_00010_29623_7512.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_141413_000002022063_00010_29623_7819.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_144858_000001282063_00011_29624_7745.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_144858_000001842063_00011_29624_7821.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_144858_000001842063_00011_29624_7876.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_160040_000000852063_00011_29624_7469.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_160040_000000852063_00011_29624_7485.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_160540_000002322063_00011_29624_7664.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_160540_000002322063_00011_29624_7825.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_173540_000002812063_00012_29625_7759.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_173540_000002812063_00012_29625_8047.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_174516_000003422063_00012_29625_7757.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_174516_000003422063_00012_29625_7904.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_191416_000003972063_00013_29626_7806.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_191416_000003972063_00013_29626_8067.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_205407_000004282063_00014_29627_8121.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_205407_000004282063_00014_29627_8217.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_215458_000002082063_00015_29628_8240.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_215458_000002082063_00015_29628_8246.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_223527_000002812063_00015_29628_8242.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_223527_000002812063_00015_29628_8275.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_224027_000001832063_00015_29628_8225.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_224027_000001832063_00015_29628_8233.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_224849_000002392063_00015_29628_8235.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20071030_224849_000002392063_00015_29628_8266.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_073404_000002982063_00006_29619_3356.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_073511_000002322063_00006_29619_3254.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_074041_000002132063_00006_29619_3354.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_074148_000001452063_00006_29619_3249.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_095007_000000672063_00008_29621_3358.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_114719_000000862063_00009_29622_3489.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_114827_000000182063_00009_29622_3411.N1					OK	OK	OK	OK




ASA_WSM_1PNPDK20071030_115417_000002132063_00009_29622_3504.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_123351_000003612063_00009_29622_3905.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_123459_000002922063_00009_29622_3643.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_183054_000001232063_00013_29626_4052.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_200232_000001702063_00014_29627_4173.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_201006_000001412063_00014_29627_4175.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_214123_000000852063_00015_29628_4199.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_214354_000000852063_00015_29628_4201.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_214820_000002452063_00015_29628_4203.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20071030_232631_000002812063_00016_29629_4215.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.


Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20071030_010800_000003152063_00002_29615_5919.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_010800_000003152063_00002_29615_6201.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_010800_000003152063_00002_29615_7009.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_010800_000003152063_00002_29615_7240.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_012046_000008092063_00003_29616_6213.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_012046_000008092063_00003_29616_6469.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_012046_000008092063_00003_29616_6980.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_012046_000008092063_00003_29616_7243.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_020605_000002692063_00003_29616_6204.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_020605_000002692063_00003_29616_6463.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_020605_000002692063_00003_29616_6977.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_020605_000002692063_00003_29616_7177.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_021347_000003902063_00003_29616_6198.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_021347_000003902063_00003_29616_6224.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_021347_000003902063_00003_29616_6466.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_021347_000003902063_00003_29616_7172.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_021947_000004652063_00003_29616_6304.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_021947_000004652063_00003_29616_6432.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_021947_000004652063_00003_29616_6653.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_021947_000004652063_00003_29616_6670.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_024415_000002852063_00003_29616_6429.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_024415_000002852063_00003_29616_6503.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_024415_000002852063_00003_29616_6650.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_024415_000002852063_00003_29616_7060.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_034907_000007492063_00004_29617_6574.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_034907_000007492063_00004_29617_7063.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_040107_000001642063_00004_29617_5826.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_040107_000001642063_00004_29617_5833.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_042451_000012292063_00004_29617_5630.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_052629_000006592063_00005_29618_5613.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_053854_000001942063_00005_29618_5591.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_054154_000003602063_00005_29618_5499.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_060527_000019192063_00005_29618_5484.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_072510_000000302063_00006_29619_6192.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_072510_000000302063_00006_29619_6195.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_072510_000000302063_00006_29619_7246.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_072510_000000302063_00006_29619_7265.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_202053_000019492063_00014_29627_7517.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_202053_000019492063_00014_29627_7671.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_211050_000001952063_00014_29627_7510.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_211050_000001952063_00014_29627_7662.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_211305_000001052063_00014_29627_7879.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_211305_000001052063_00014_29627_7967.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_220016_000001352063_00015_29628_7772.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_220411_000018292063_00015_29628_7884.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_220411_000018292063_00015_29628_7972.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_225244_000001952063_00015_29628_7887.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_225244_000001952063_00015_29628_7975.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_225459_000008992063_00015_29628_8104.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_231431_000006742063_00016_29629_8107.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20071030_234439_000009892063_00016_29629_8129.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_072510_000001952063_00006_29619_3171.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_074603_000019492063_00006_29619_3220.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_085544_000008392063_00007_29620_3263.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_092639_000013642063_00007_29620_3266.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_095127_000005242063_00008_29621_3278.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_103237_000010642063_00008_29621_3390.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_110716_000002102063_00008_29621_3393.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_111310_000016192063_00008_29621_3400.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_115748_000003002063_00009_29622_3509.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_120421_000006292063_00009_29622_3514.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_122142_000005552063_00009_29622_3521.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_124750_000003152063_00009_29622_3524.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_130134_000007342063_00009_29622_3529.N1					OK	OK	OK	OK

ASA_WVS_1PNPDK20071030_133830_000005842063_00010_29623_3664.N1	OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_140838_000001802063_00010_29623_3777.N1	OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_142826_000003902063_00010_29623_3780.N1	OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_143937_000004792063_00010_29623_3785.N1	OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_153308_000011392063_00011_29624_3811.N1	OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_160930_000012292063_00011_29624_3825.N1	OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_171018_000013492063_00012_29625_3942.N1	OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_175057_000012142063_00012_29625_3947.N1	OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_184428_000017392063_00013_29626_4064.N1	OK	OK	OK	OK
ASA_WVS_1PNPDK20071030_193014_000007052063_00013_29626_4074.N1	OK	OK	OK	OK


### Calibration pulses for GM1 SS3 H/H

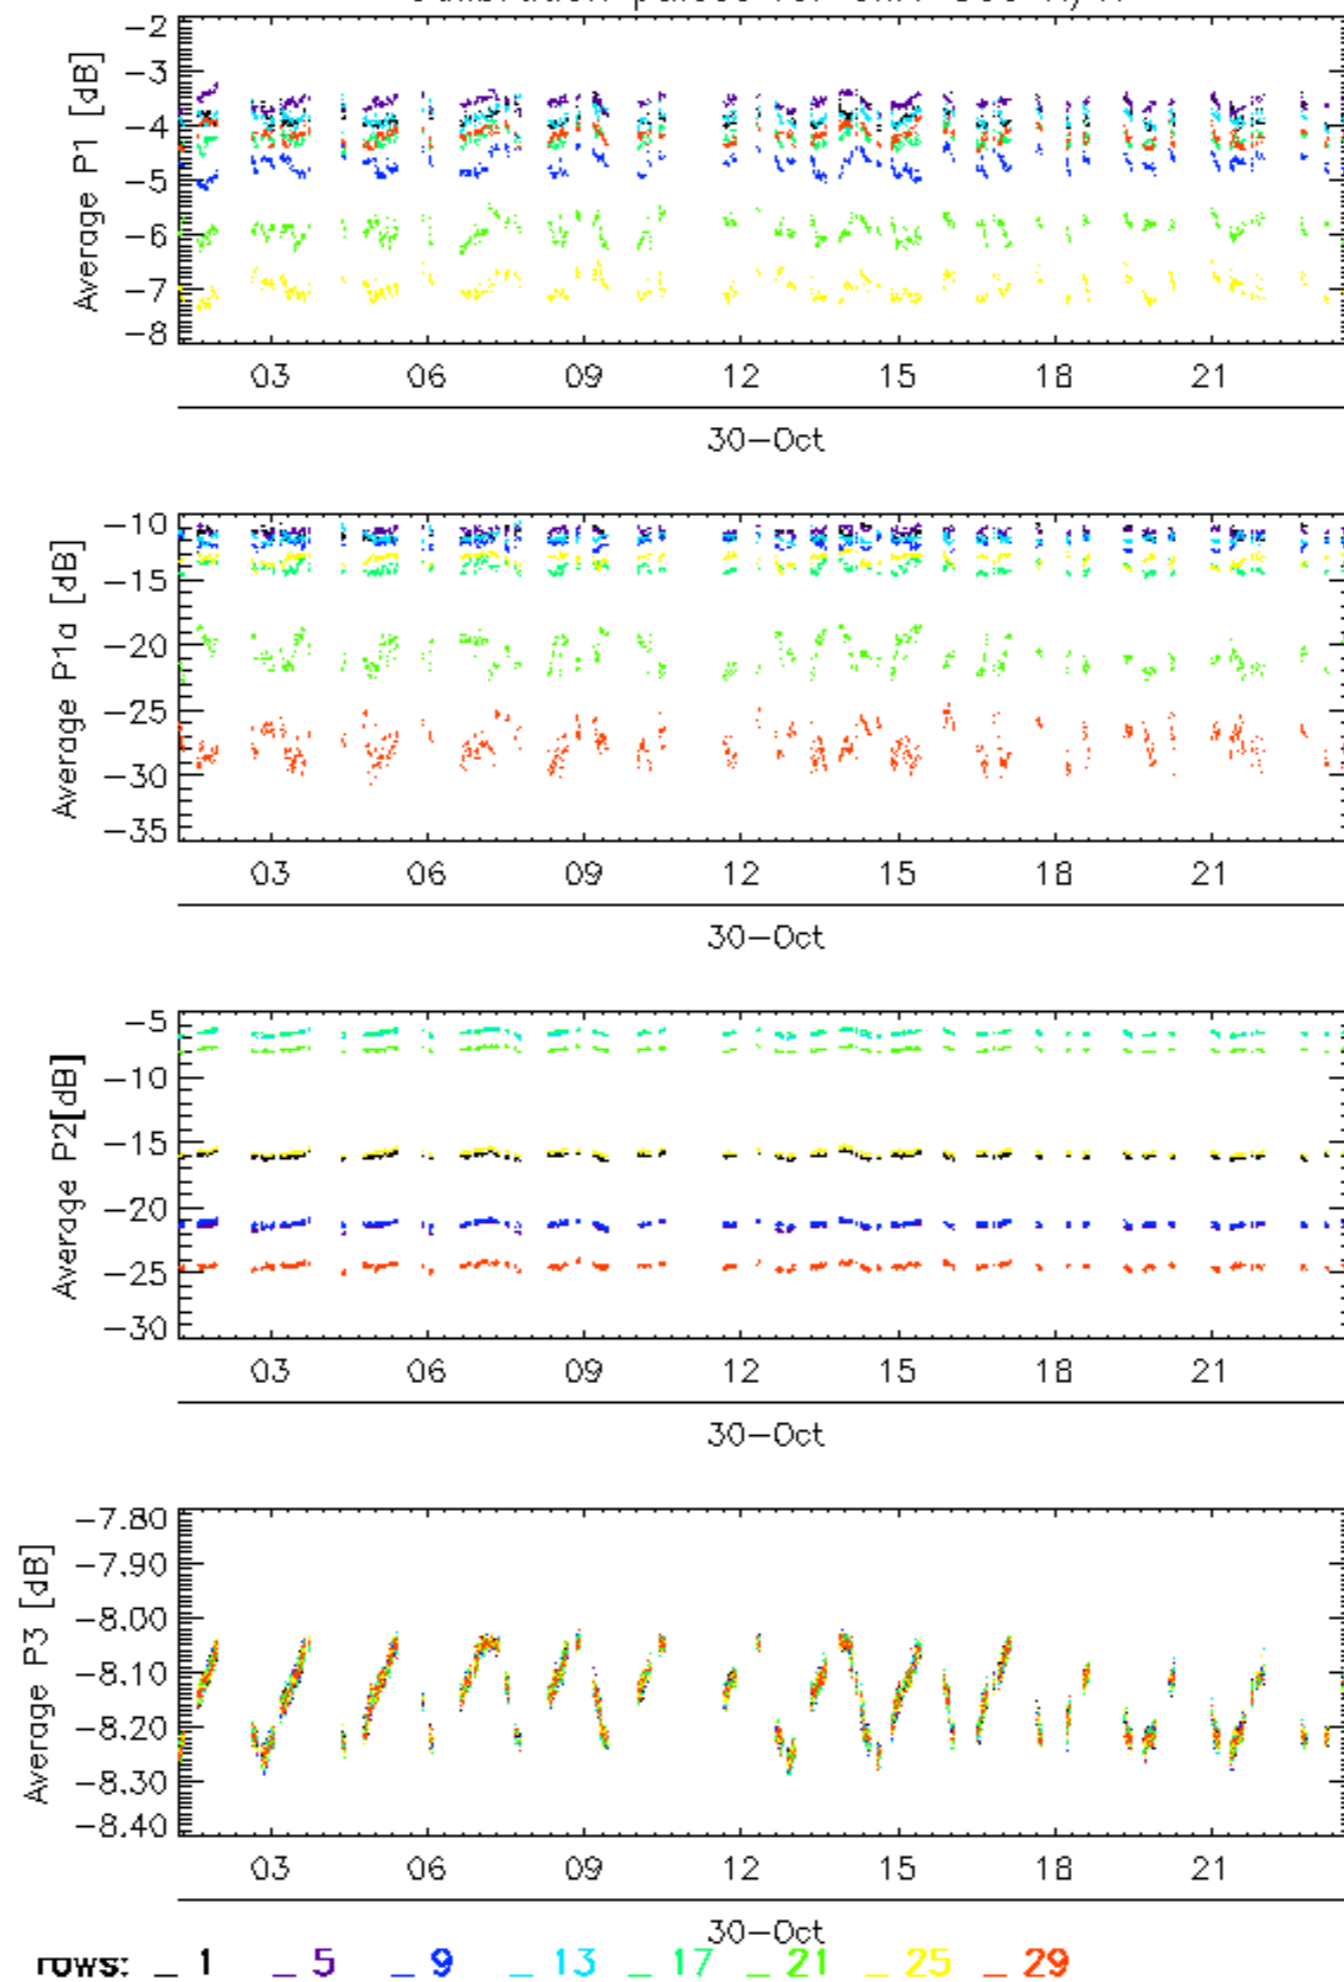


Calibration pulses for GM1 SS3 H/H

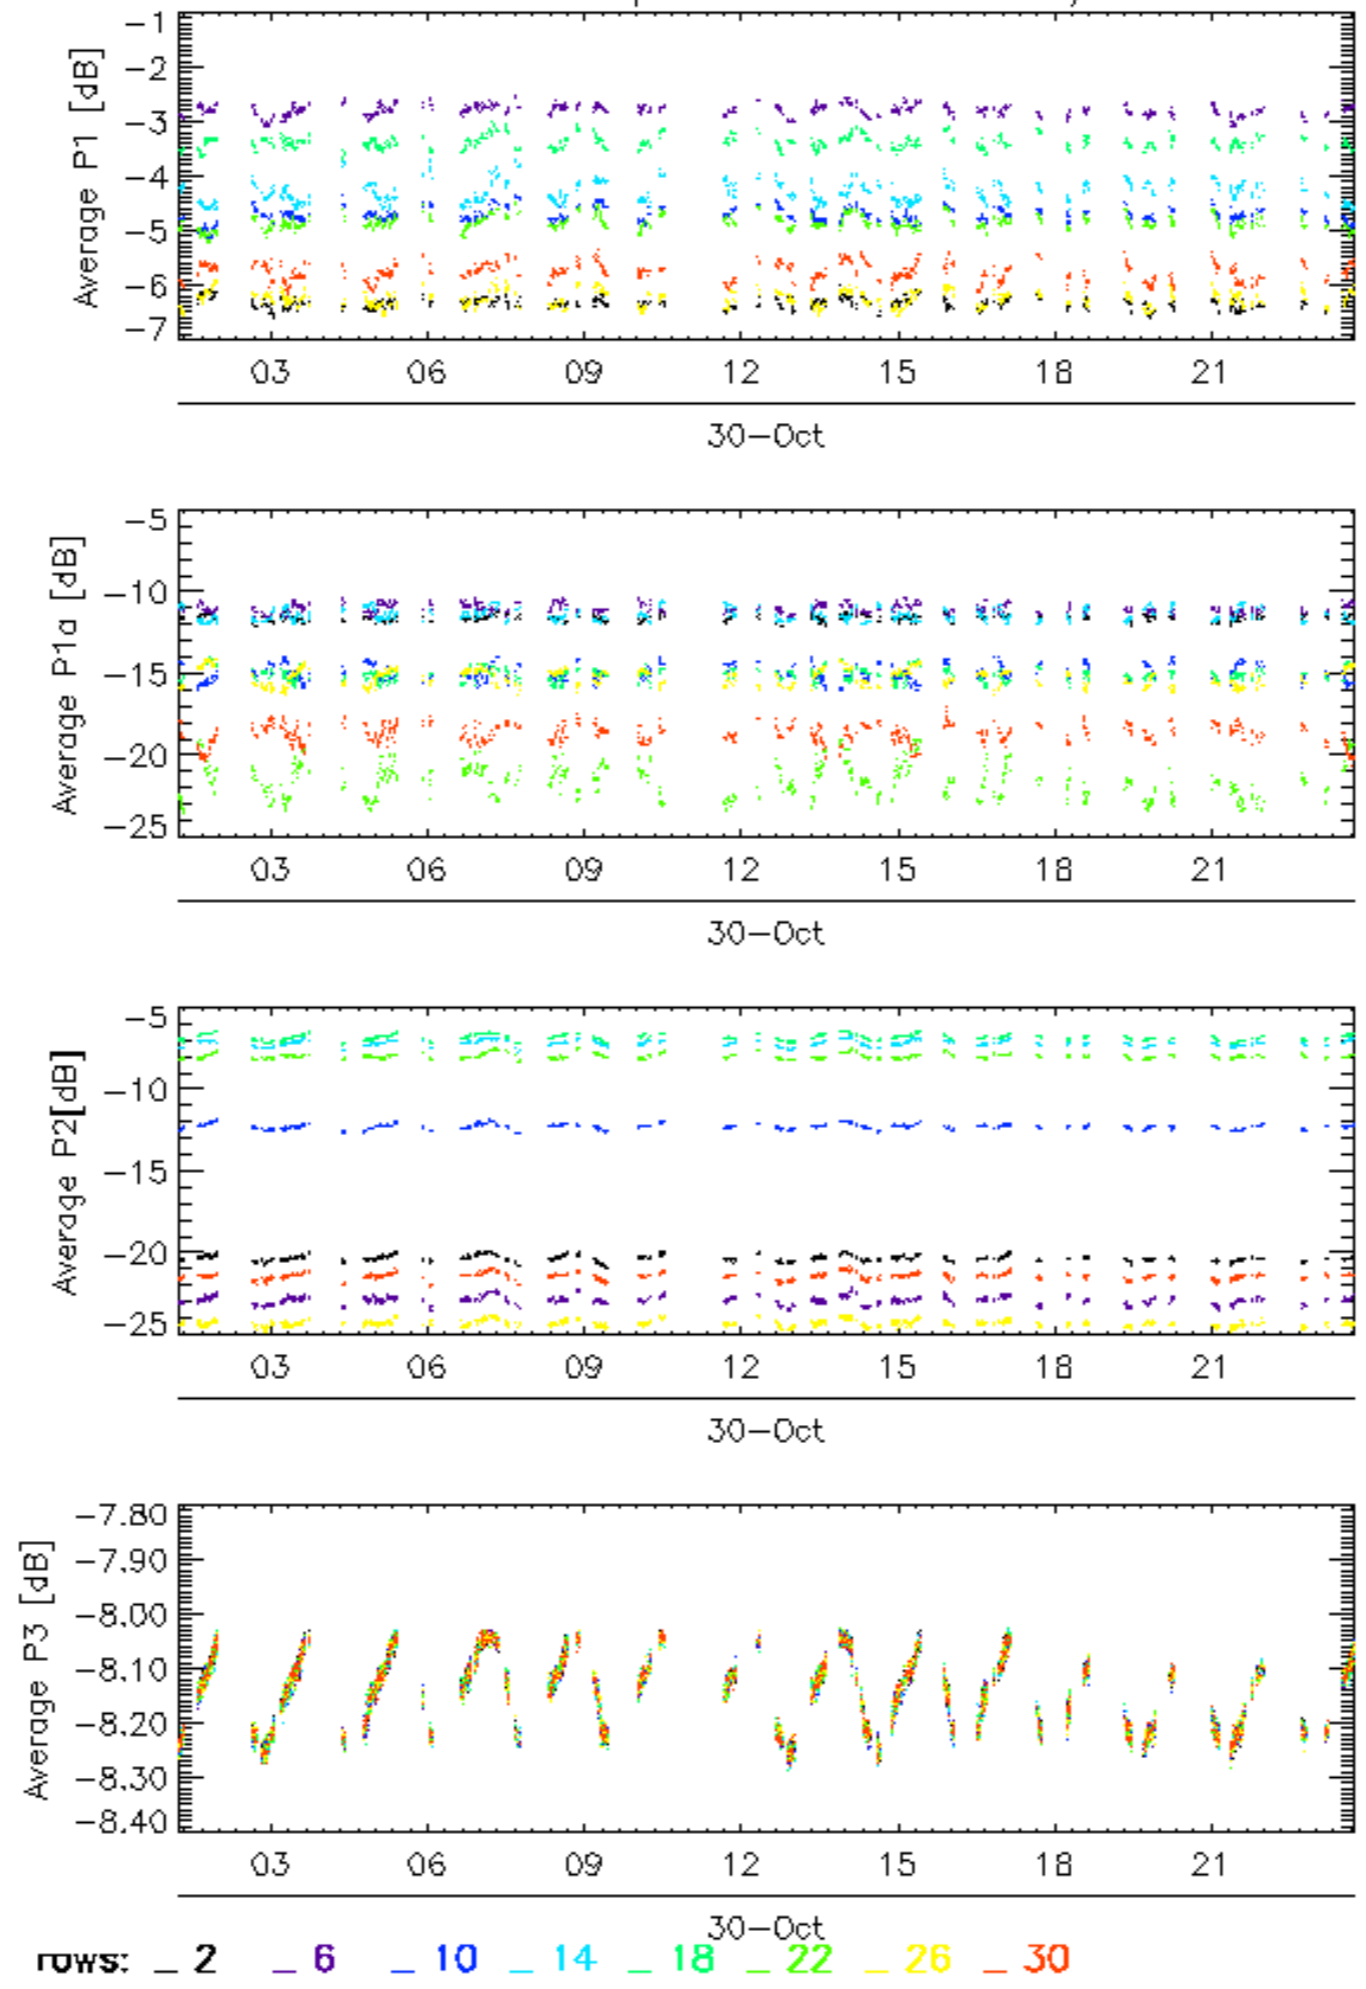


Calibration pulses for GM1 SS3 H/H

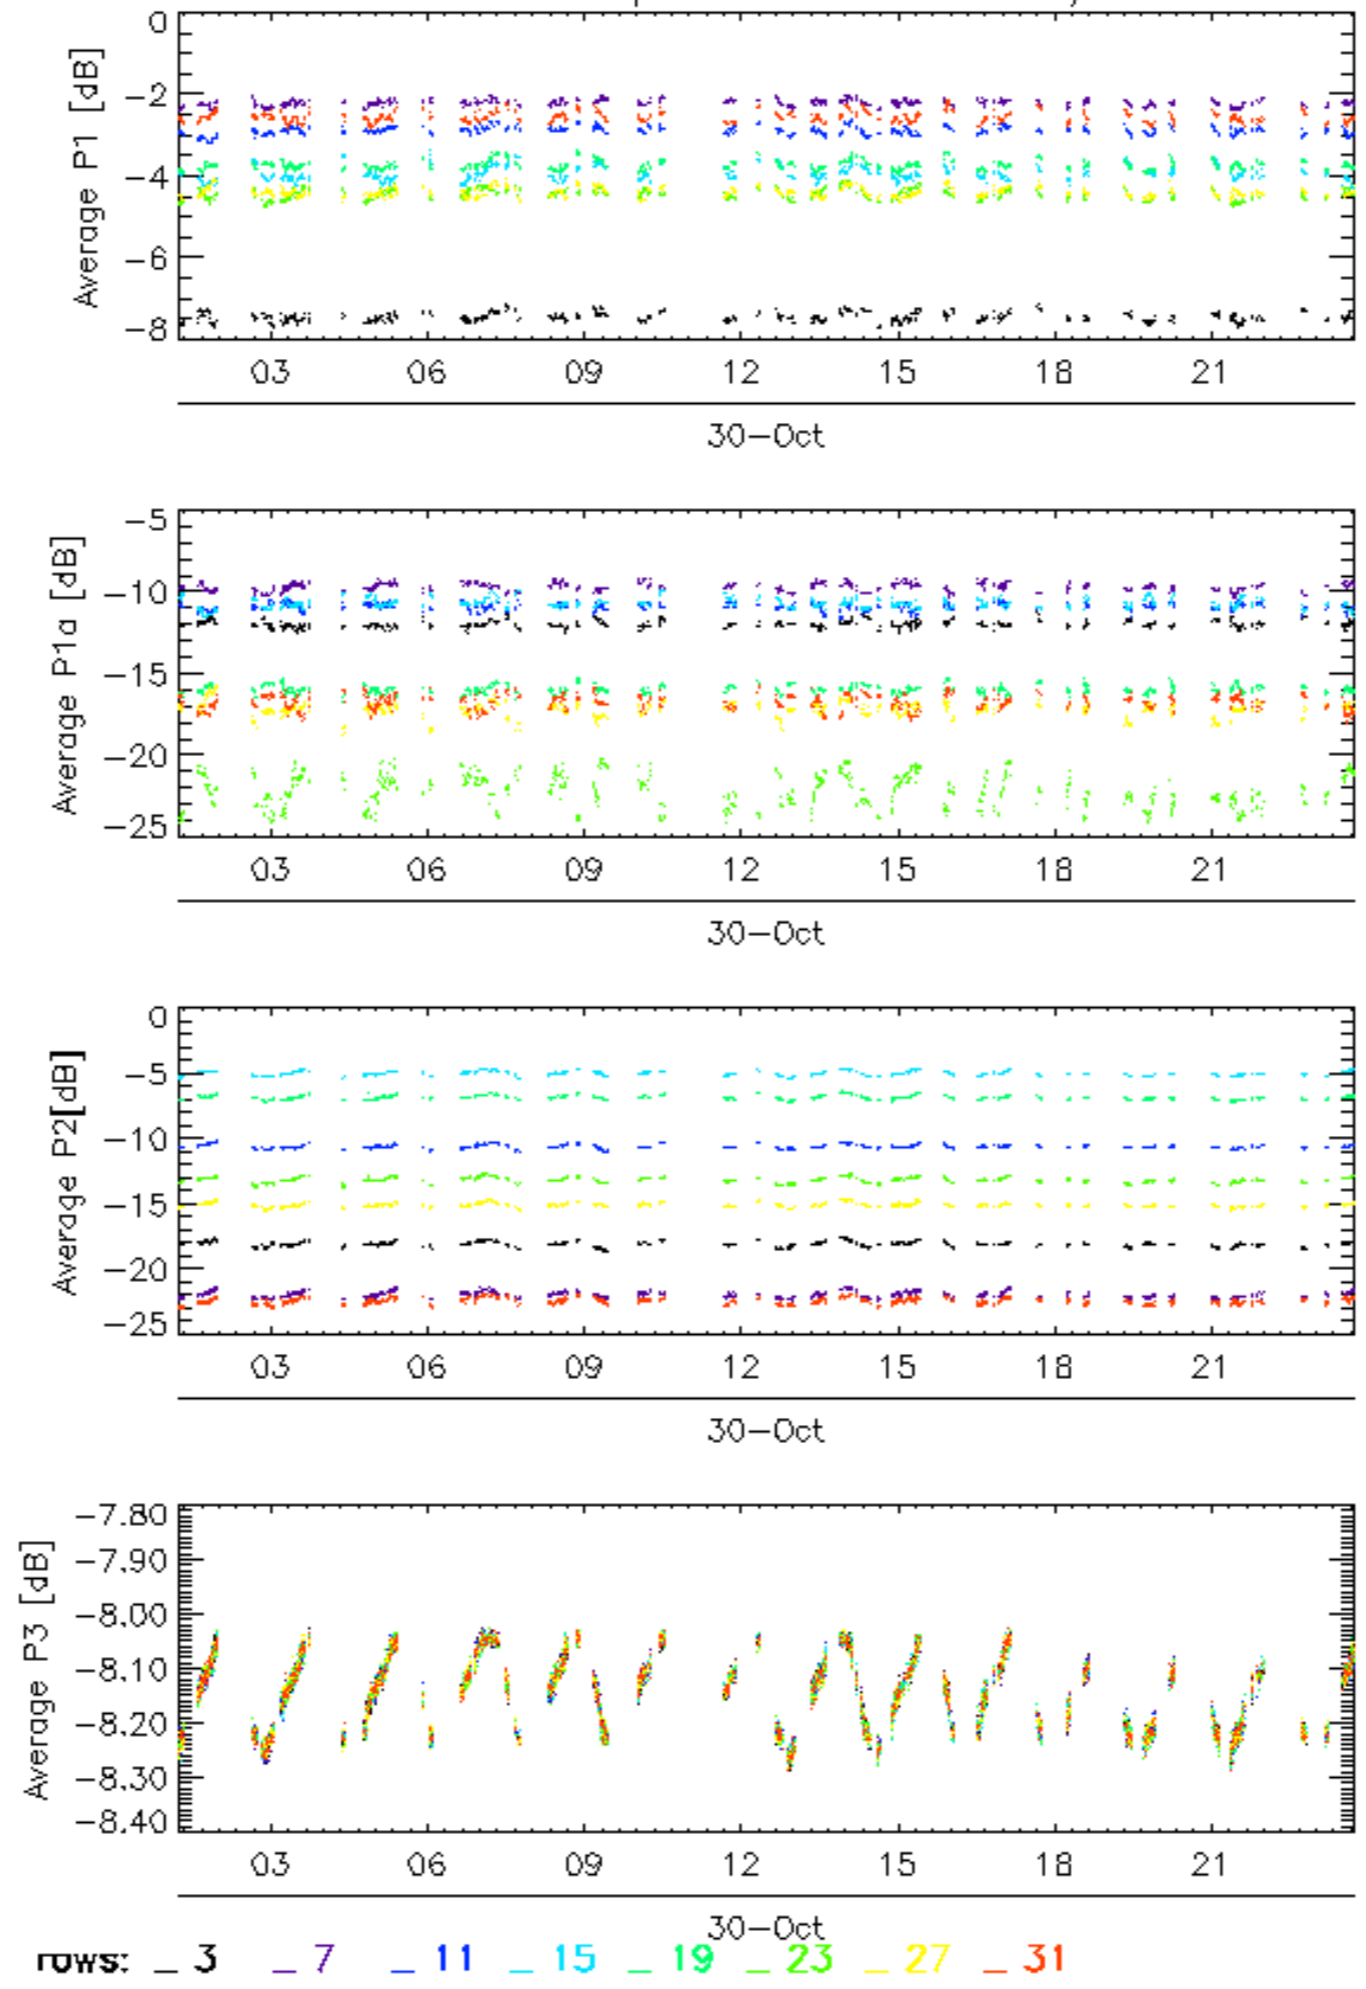

Calibration pulses for GM1 SS3 H/H

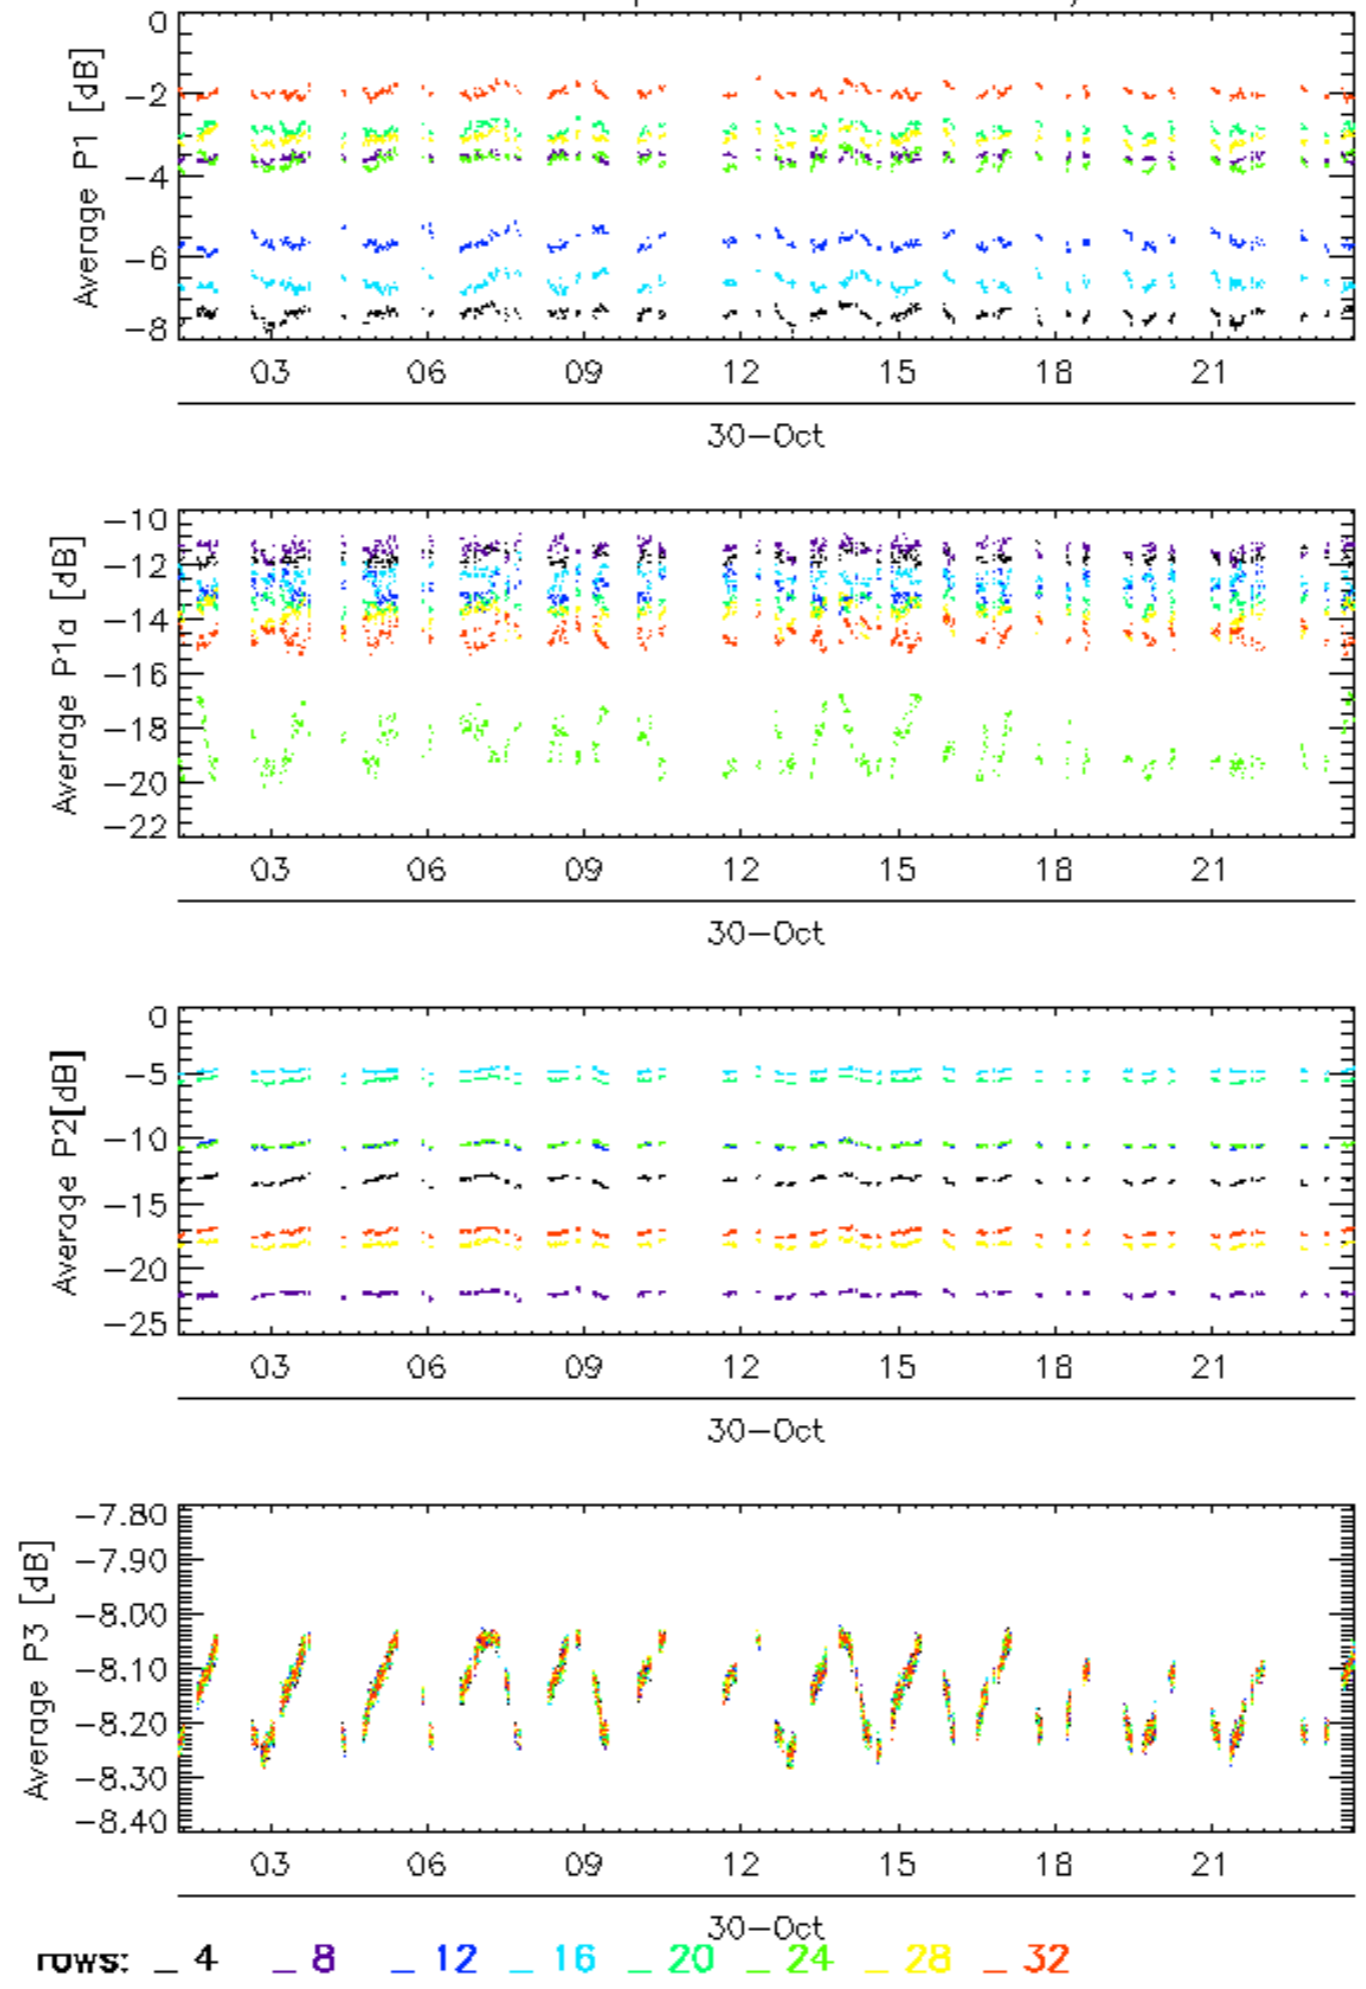


### Calibration pulses for WVS IS2 V/V

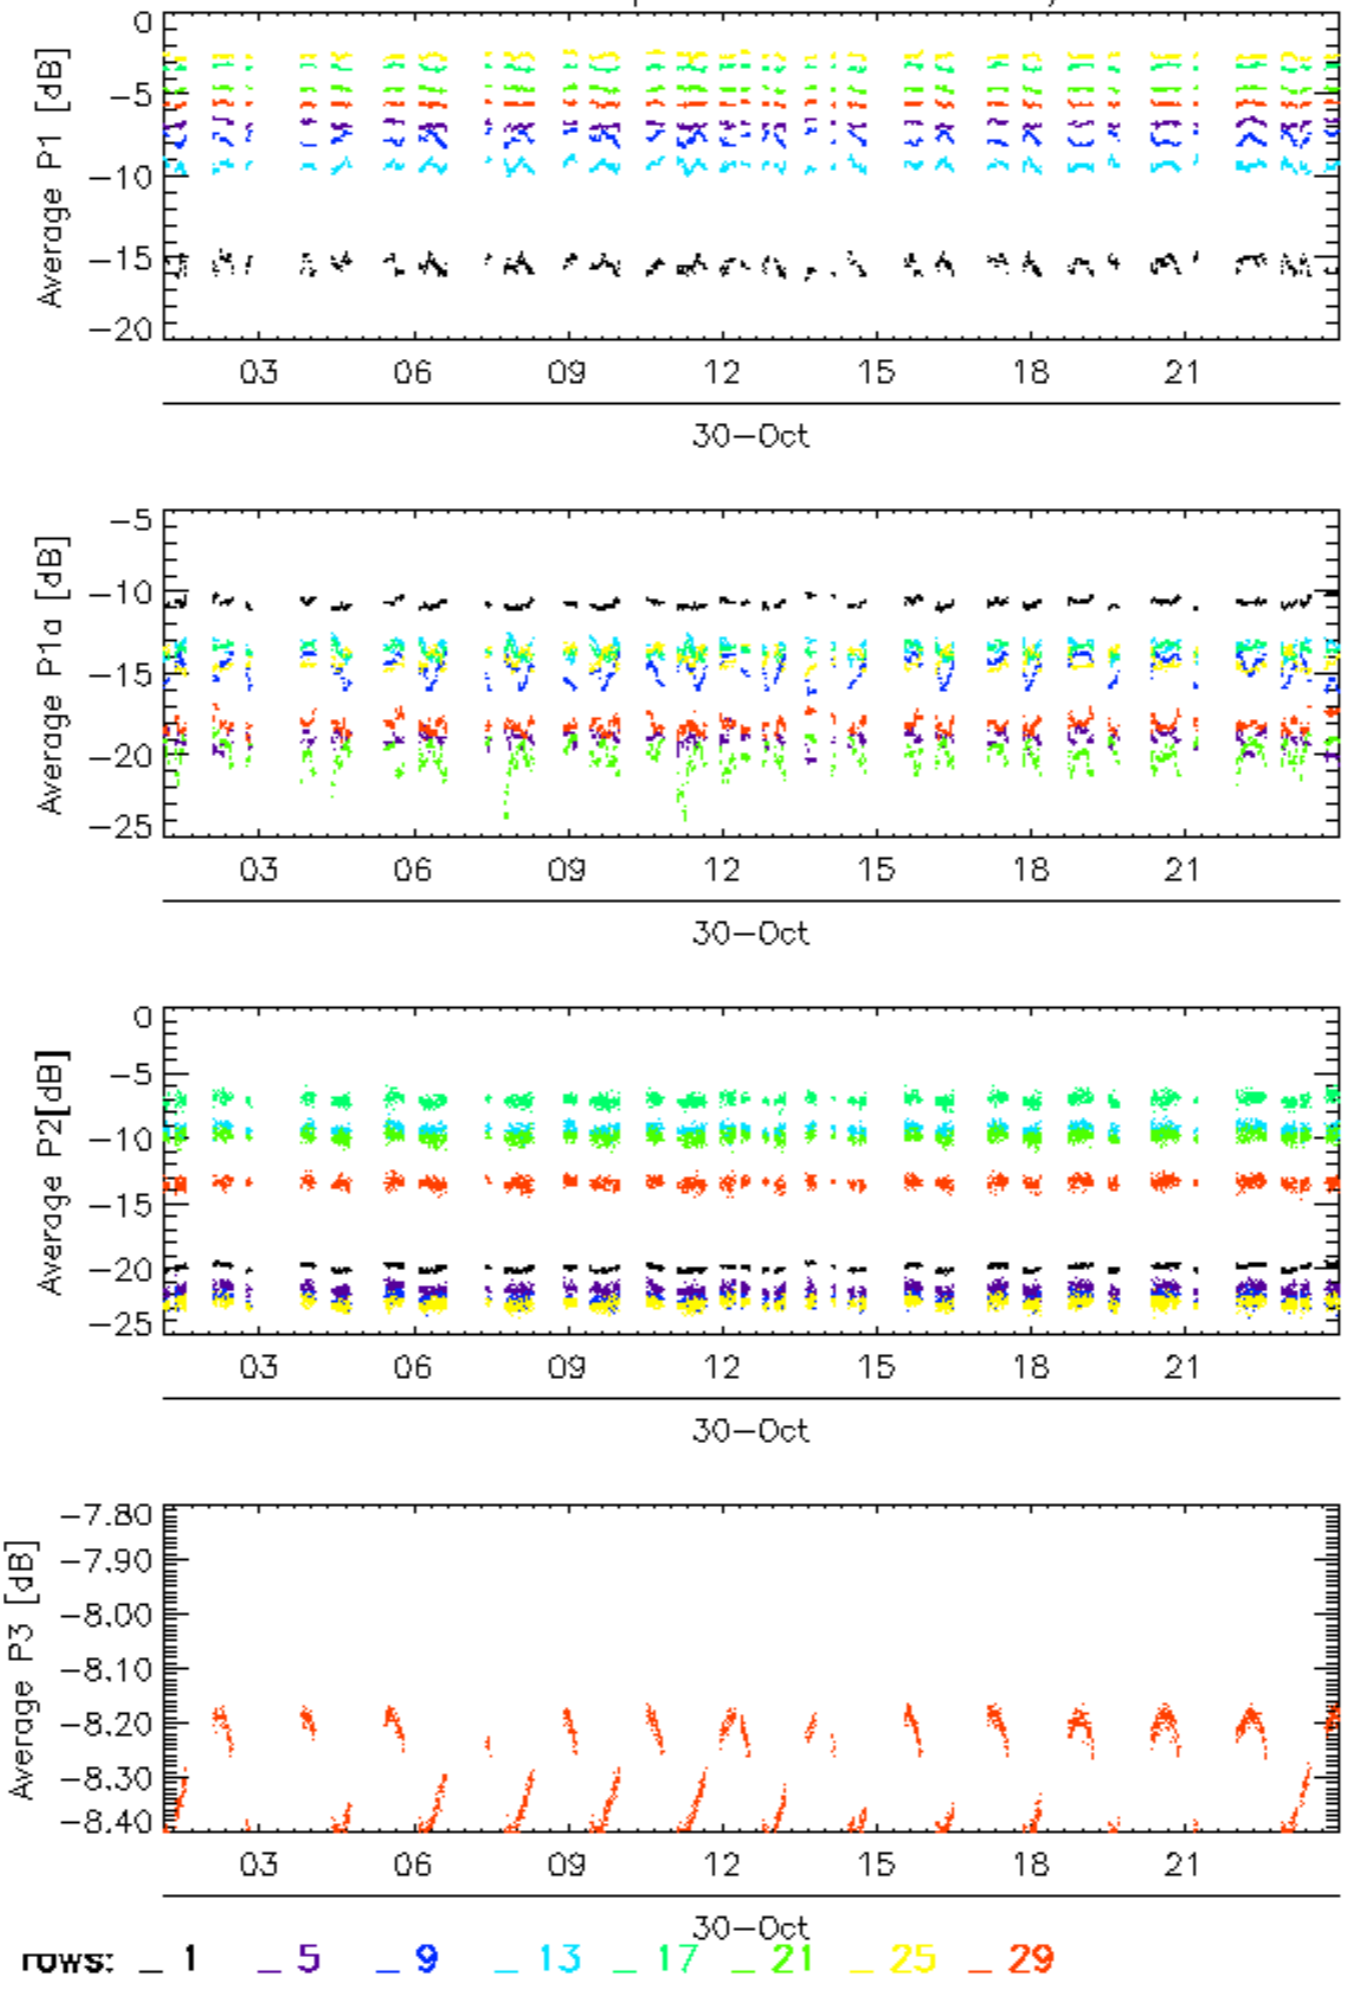





### Calibration pulses for WVS IS2 V/V

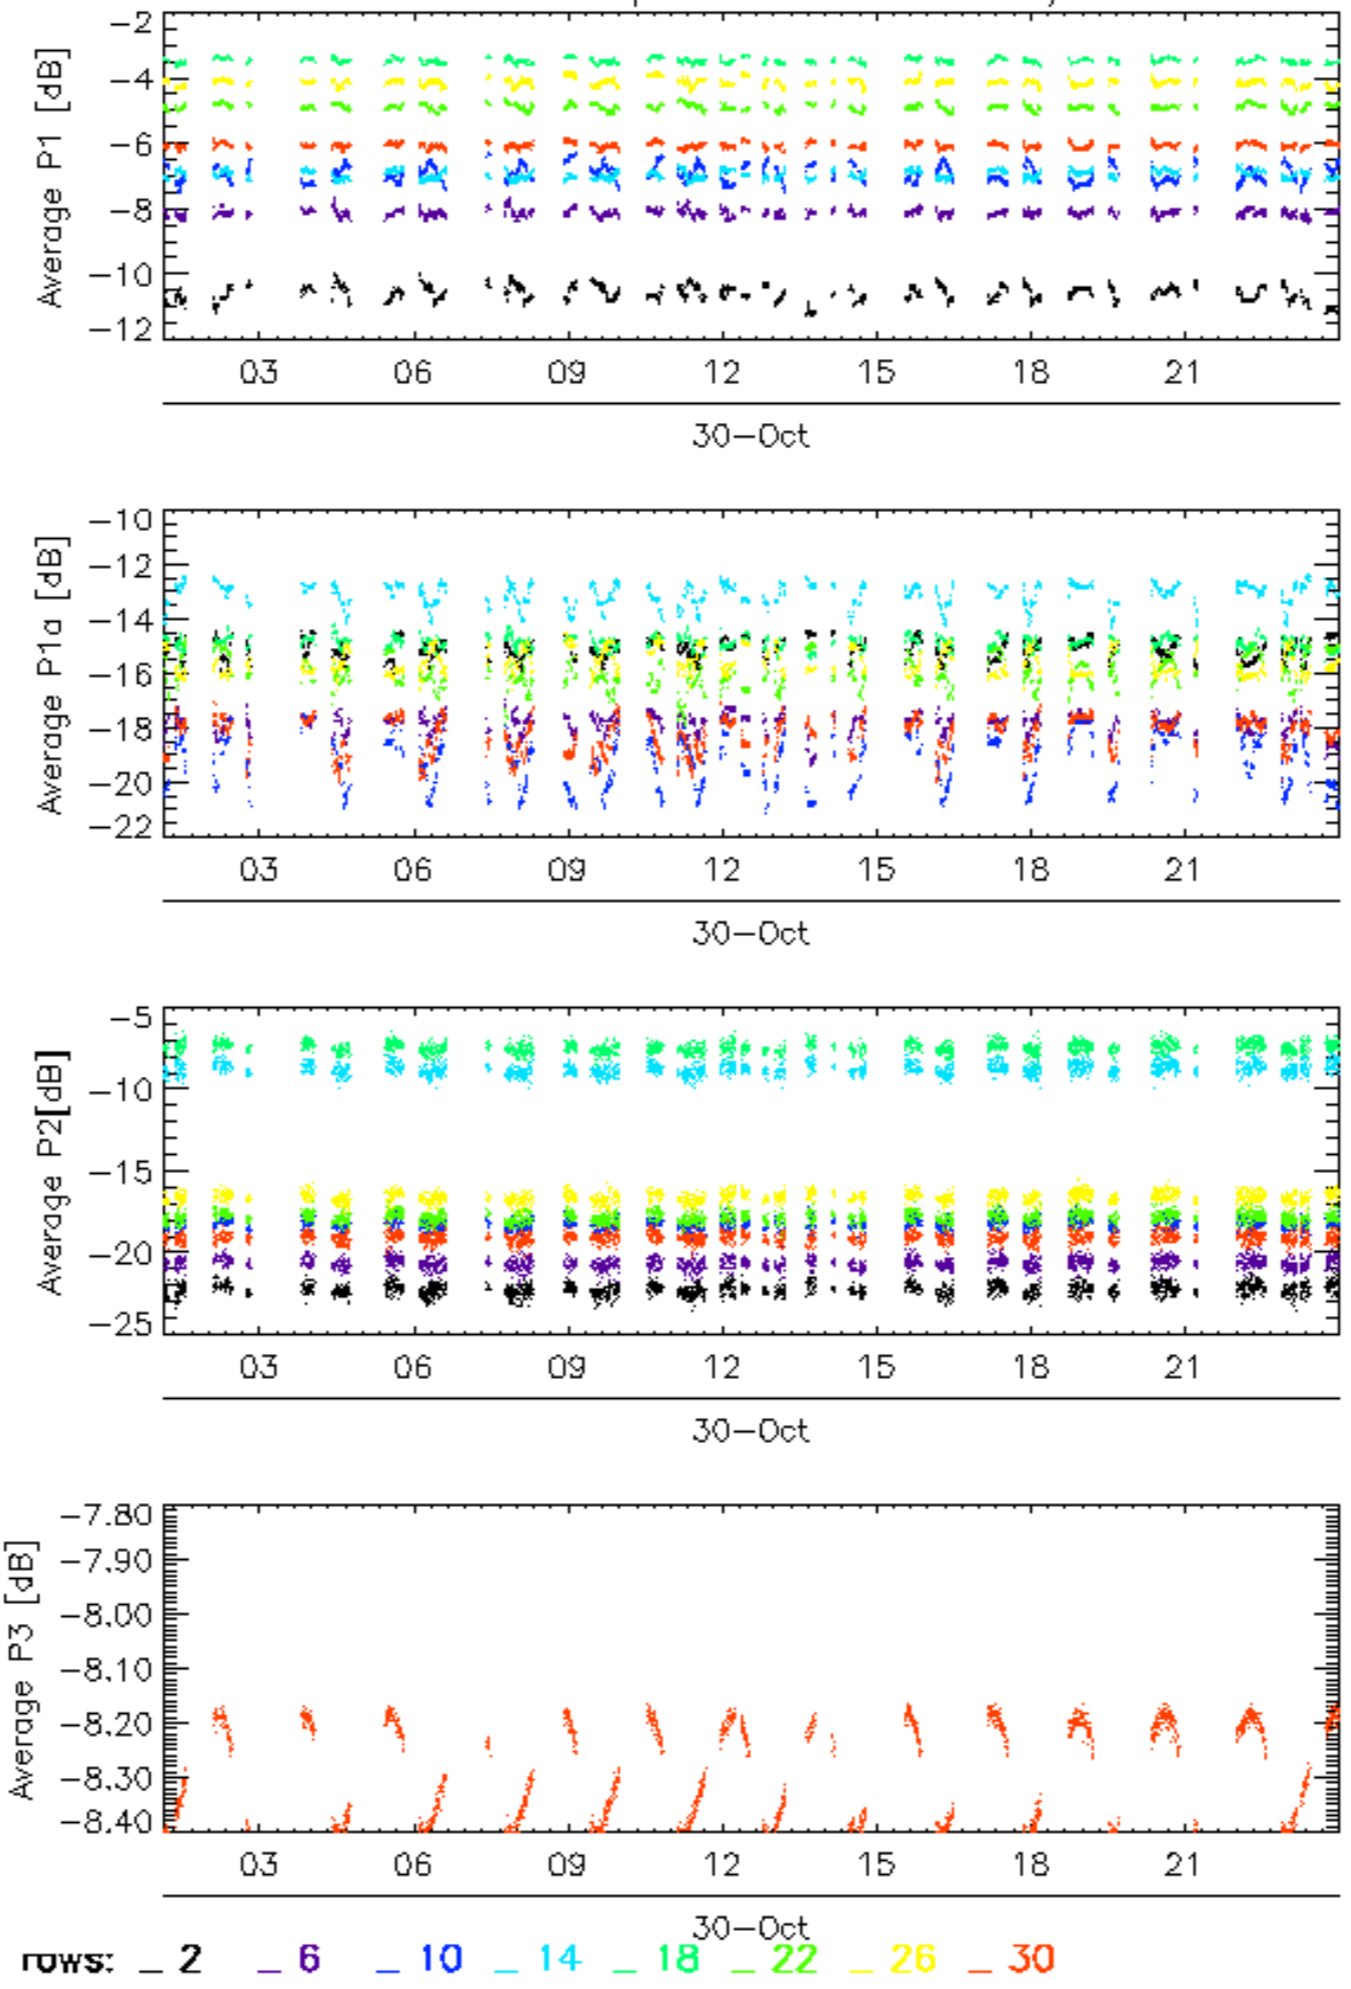



### Calibration pulses for WVS IS2 V/V


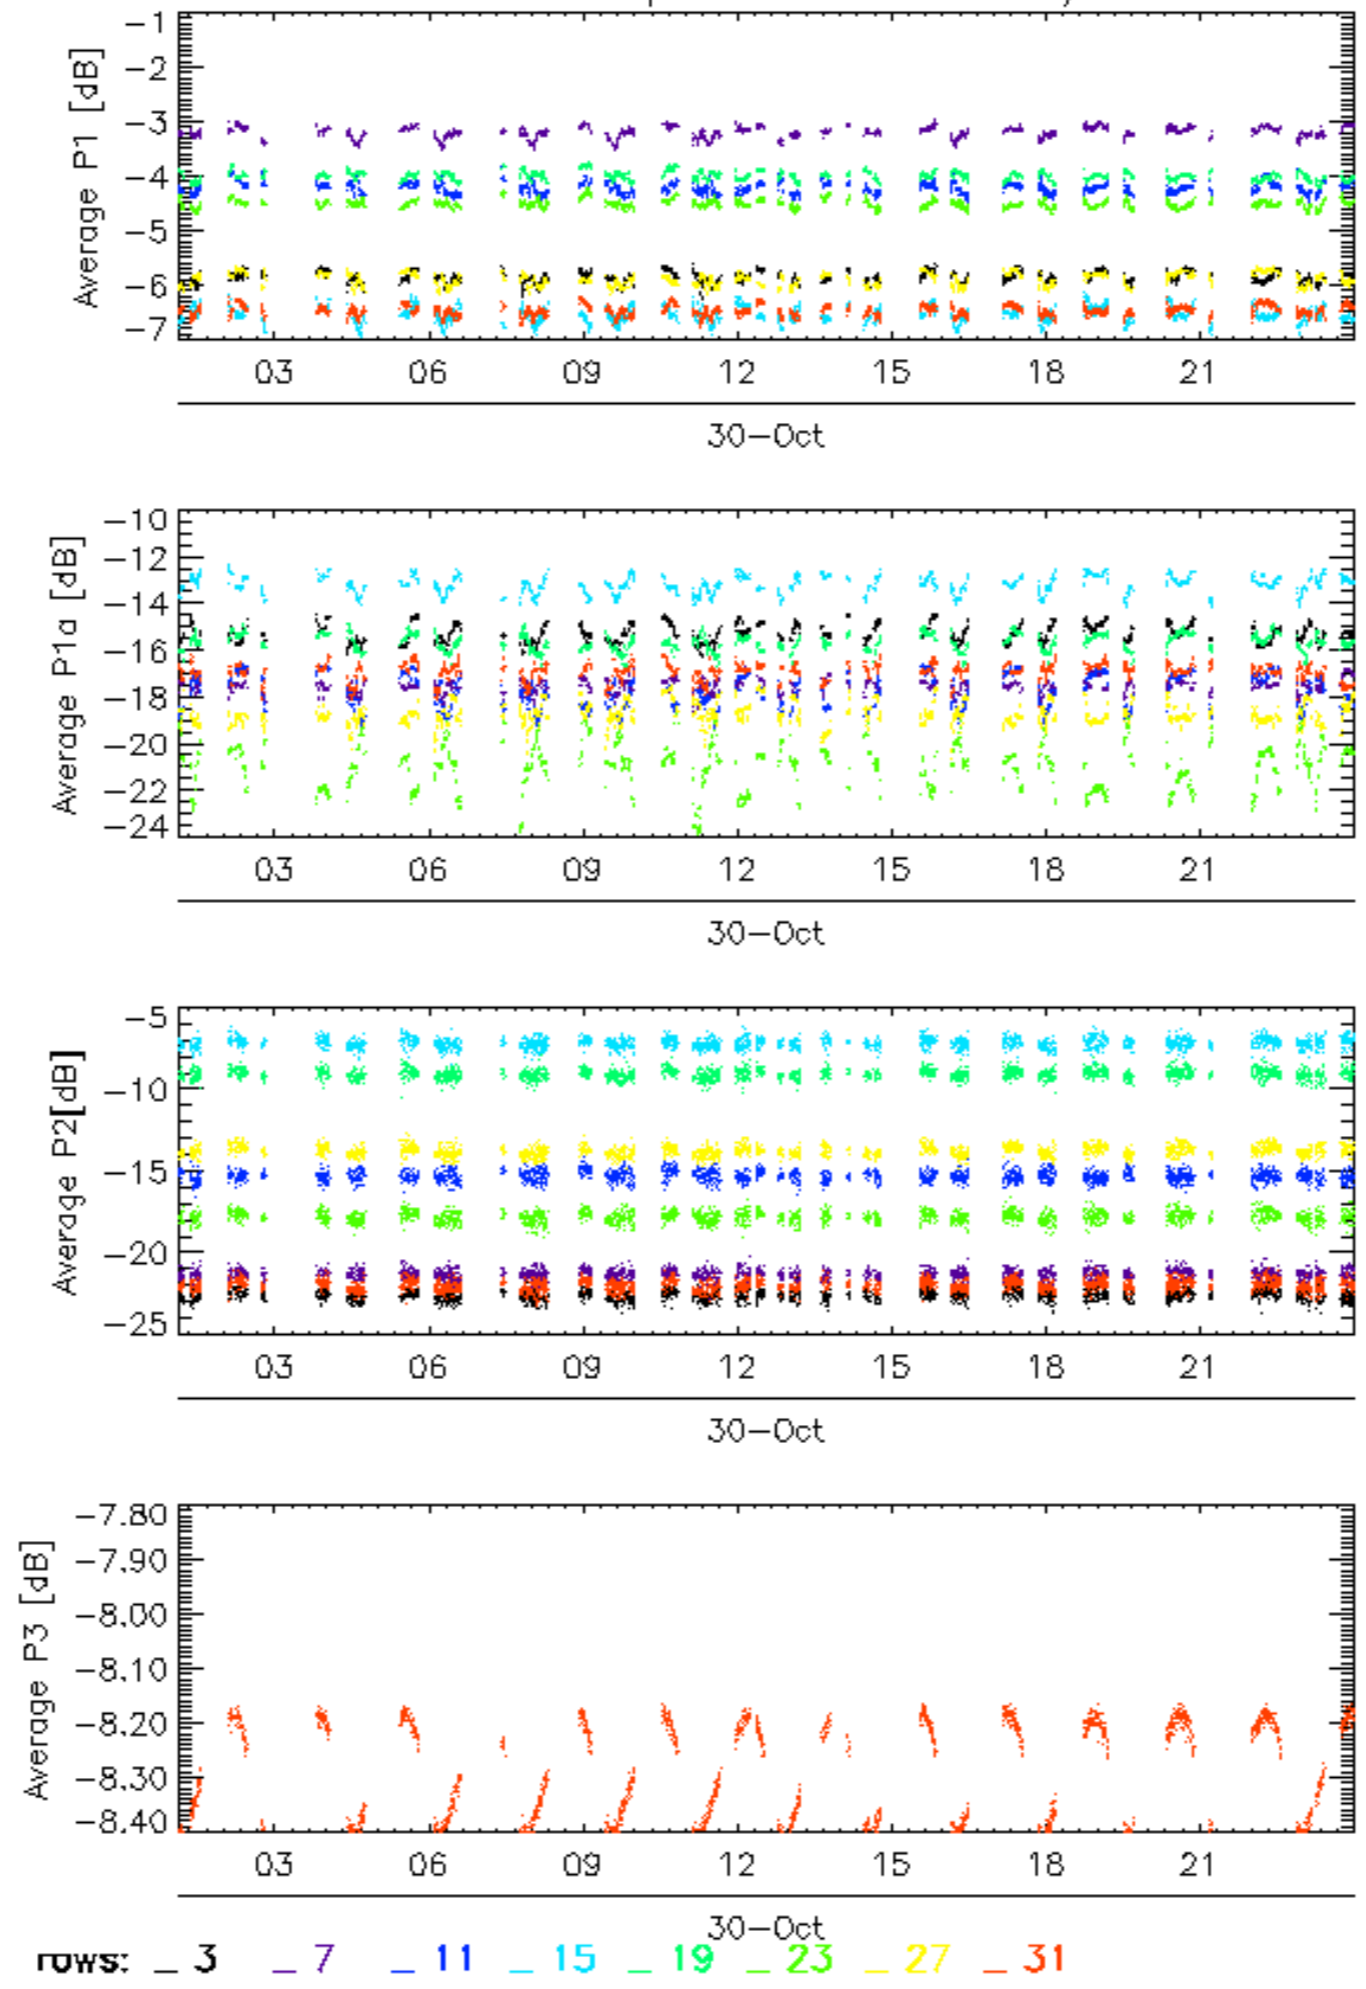


Calibration pulses for WVS IS2 V/V


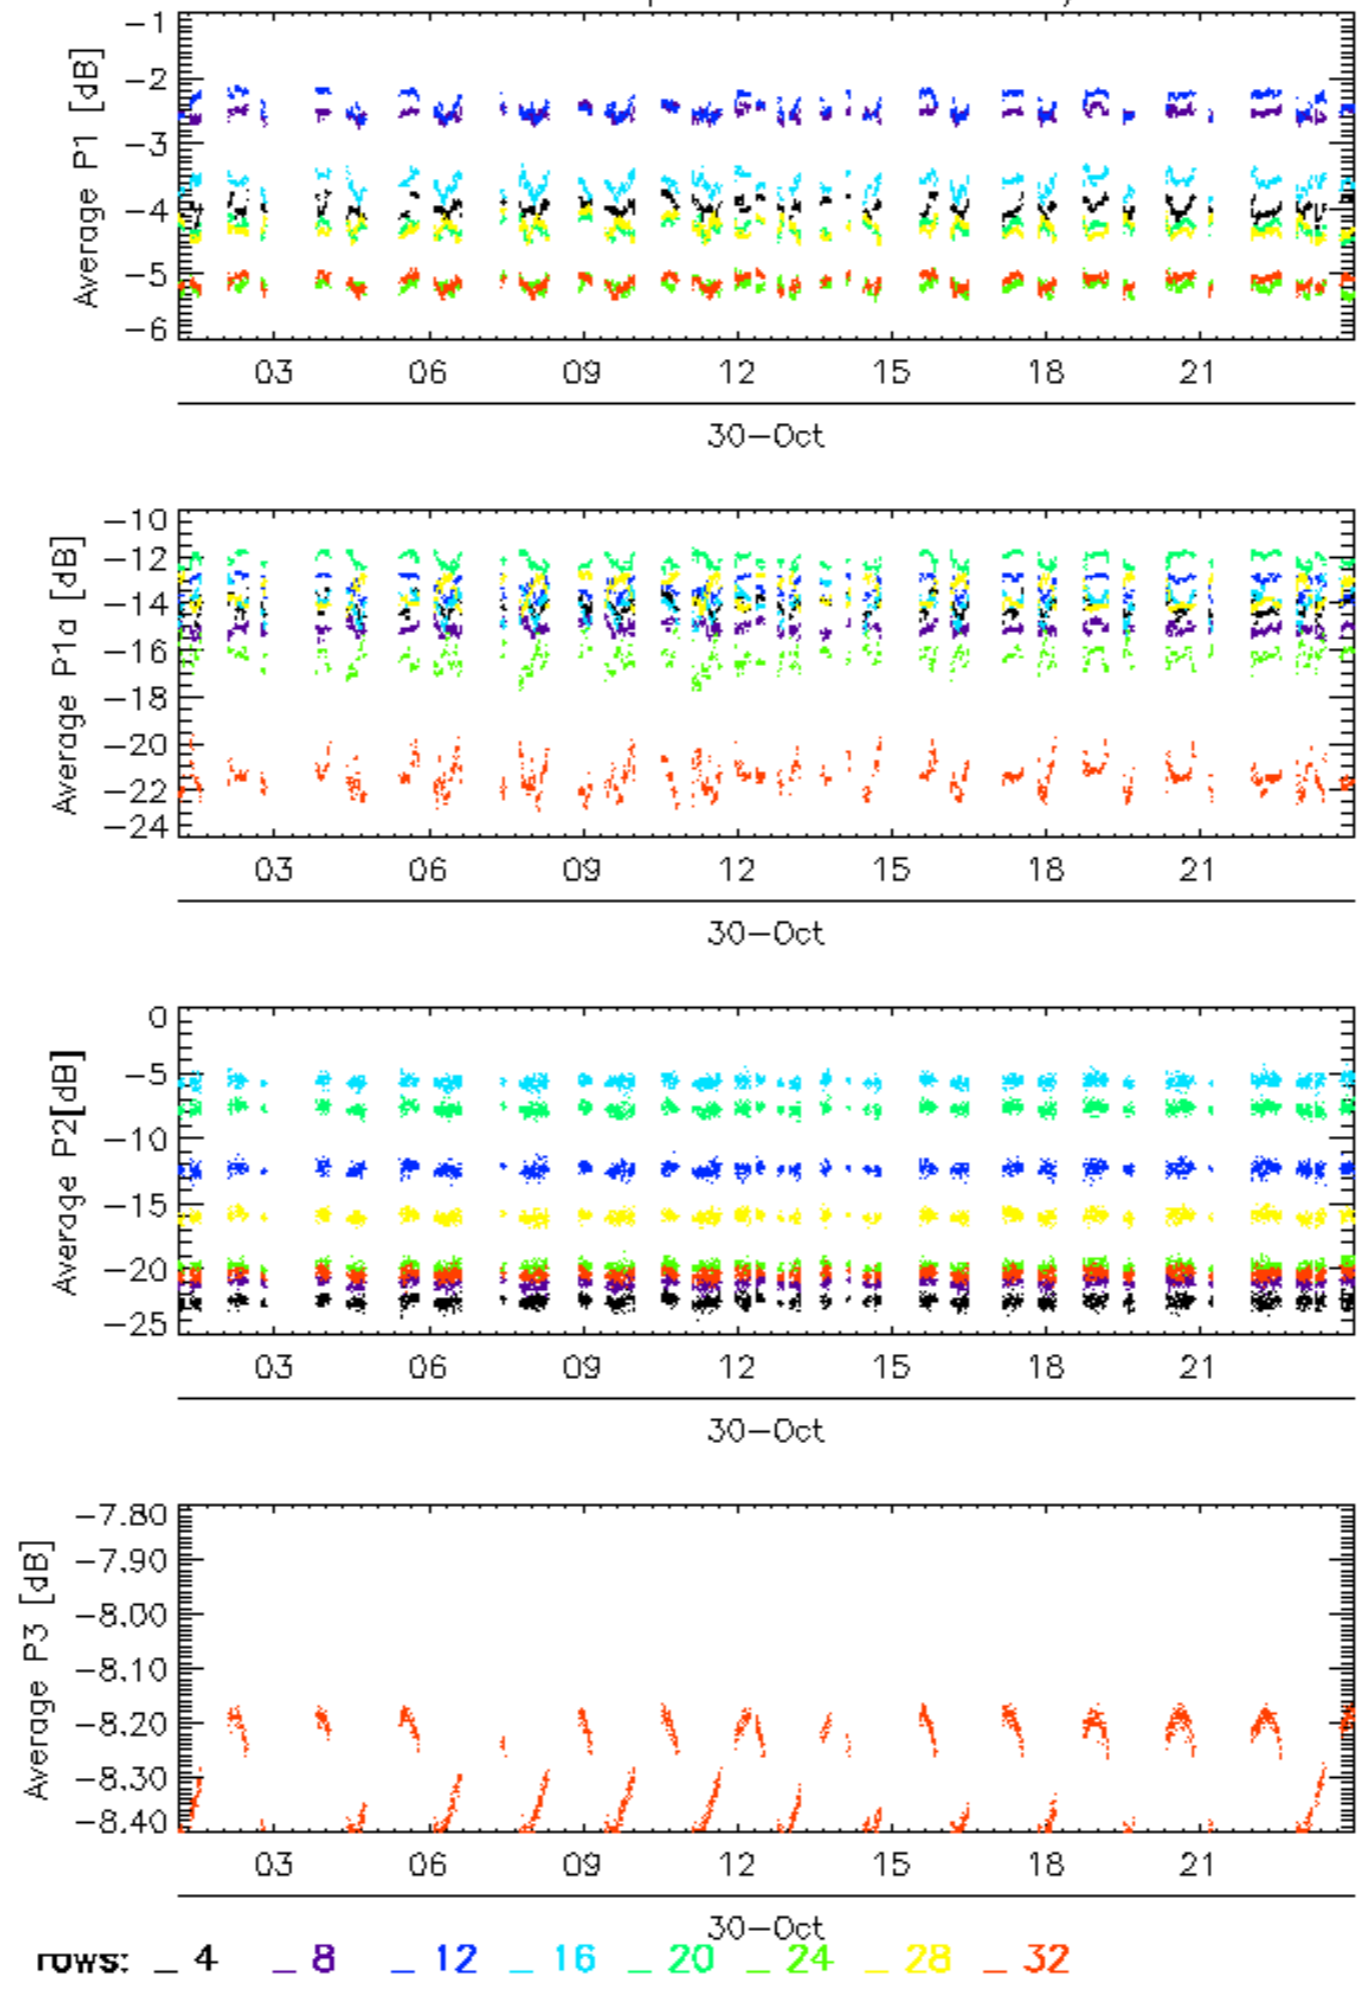



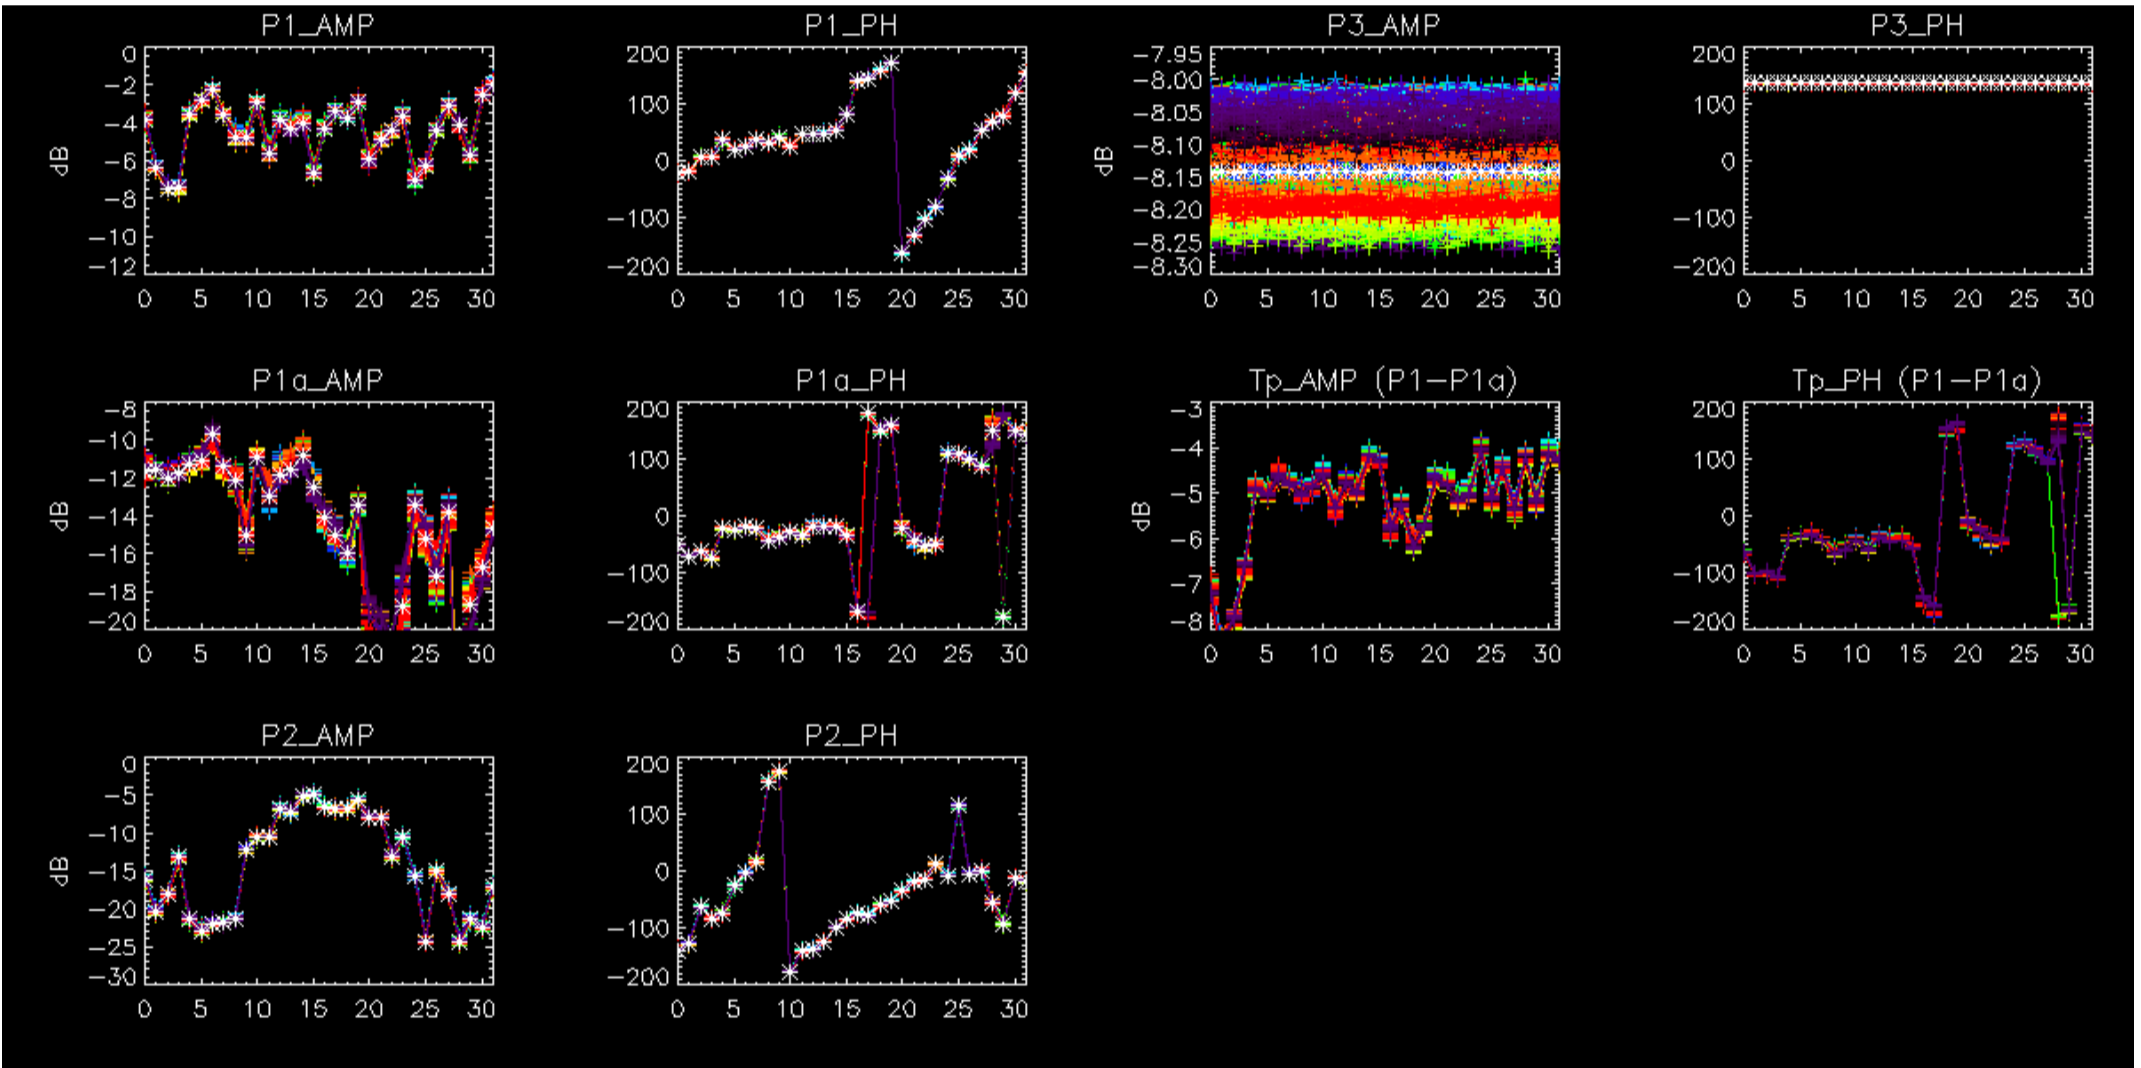


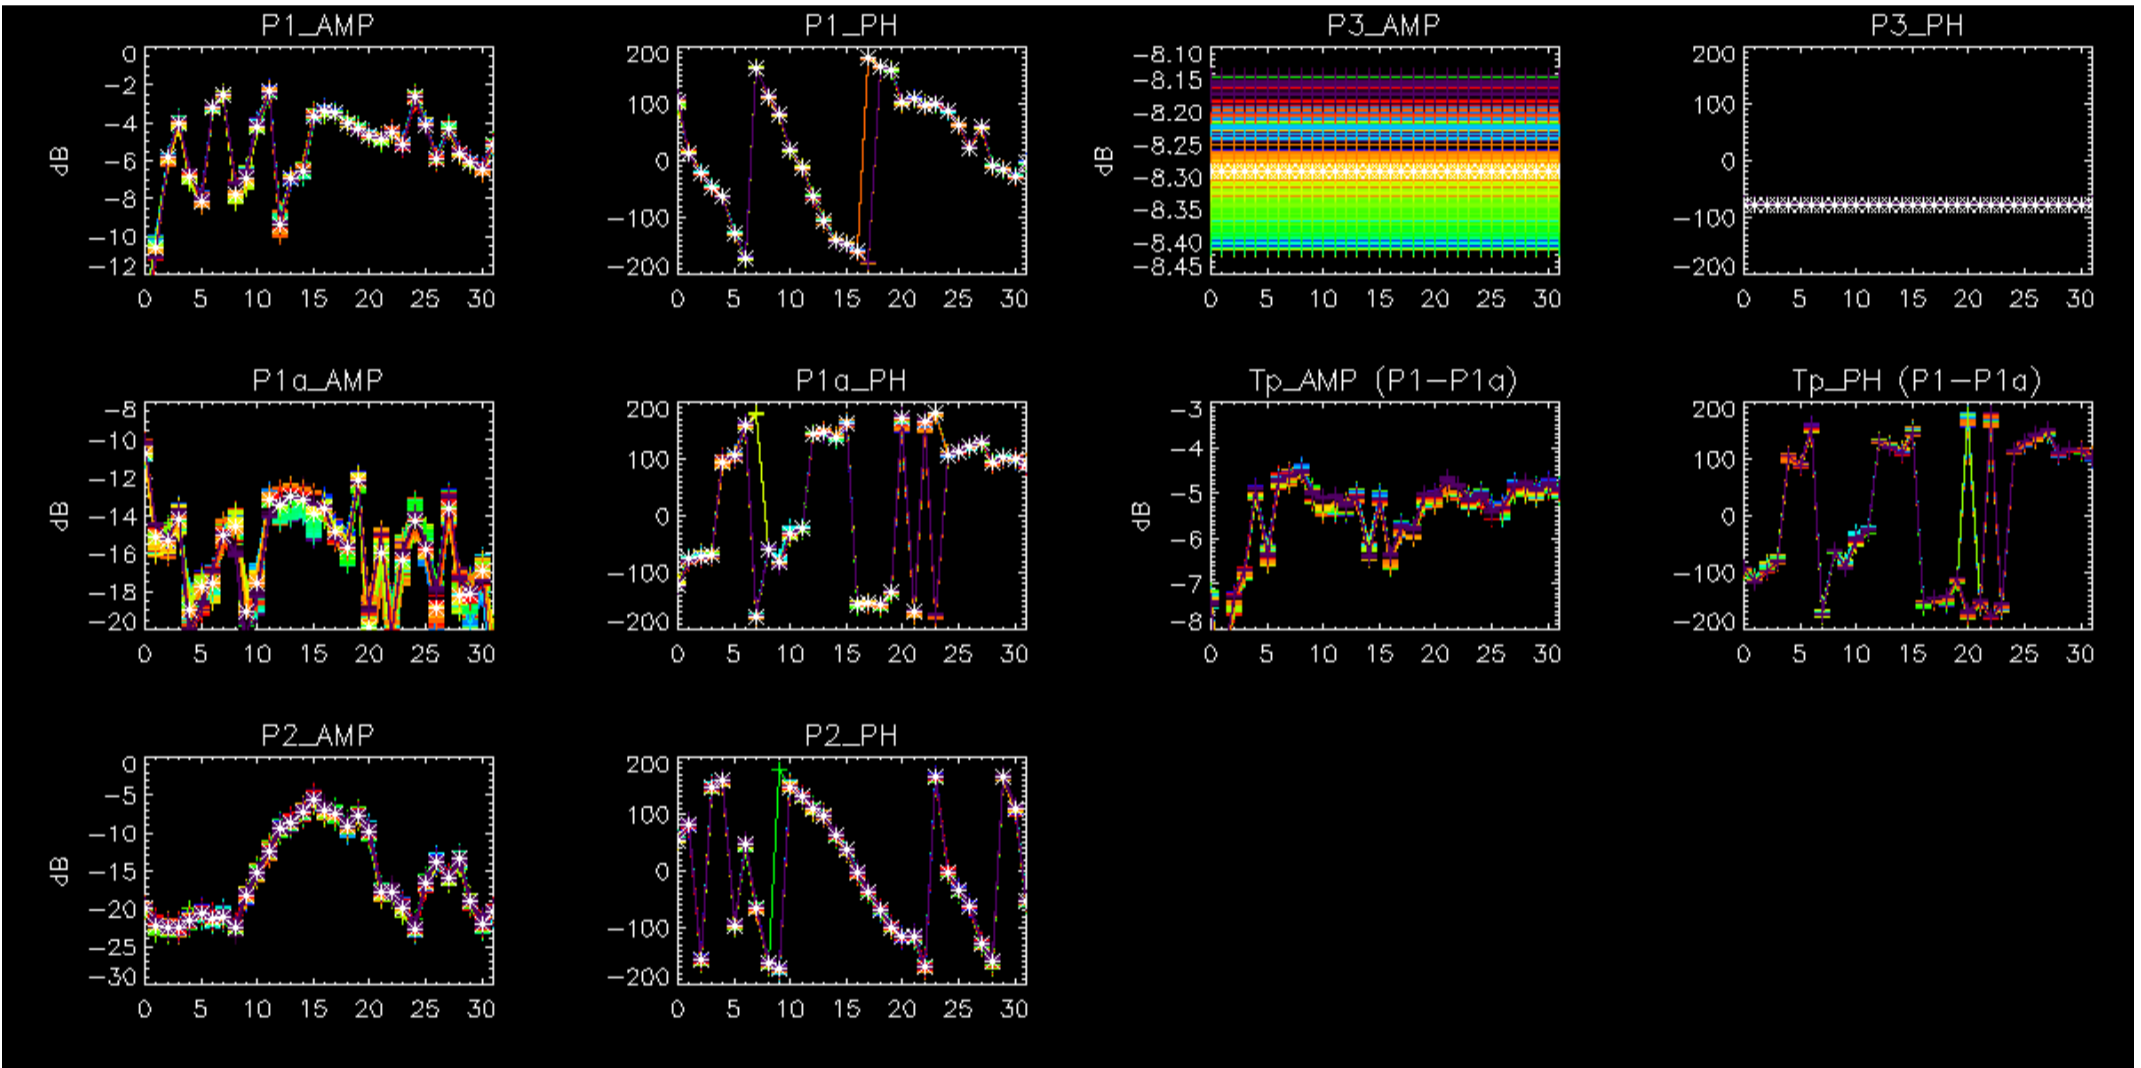

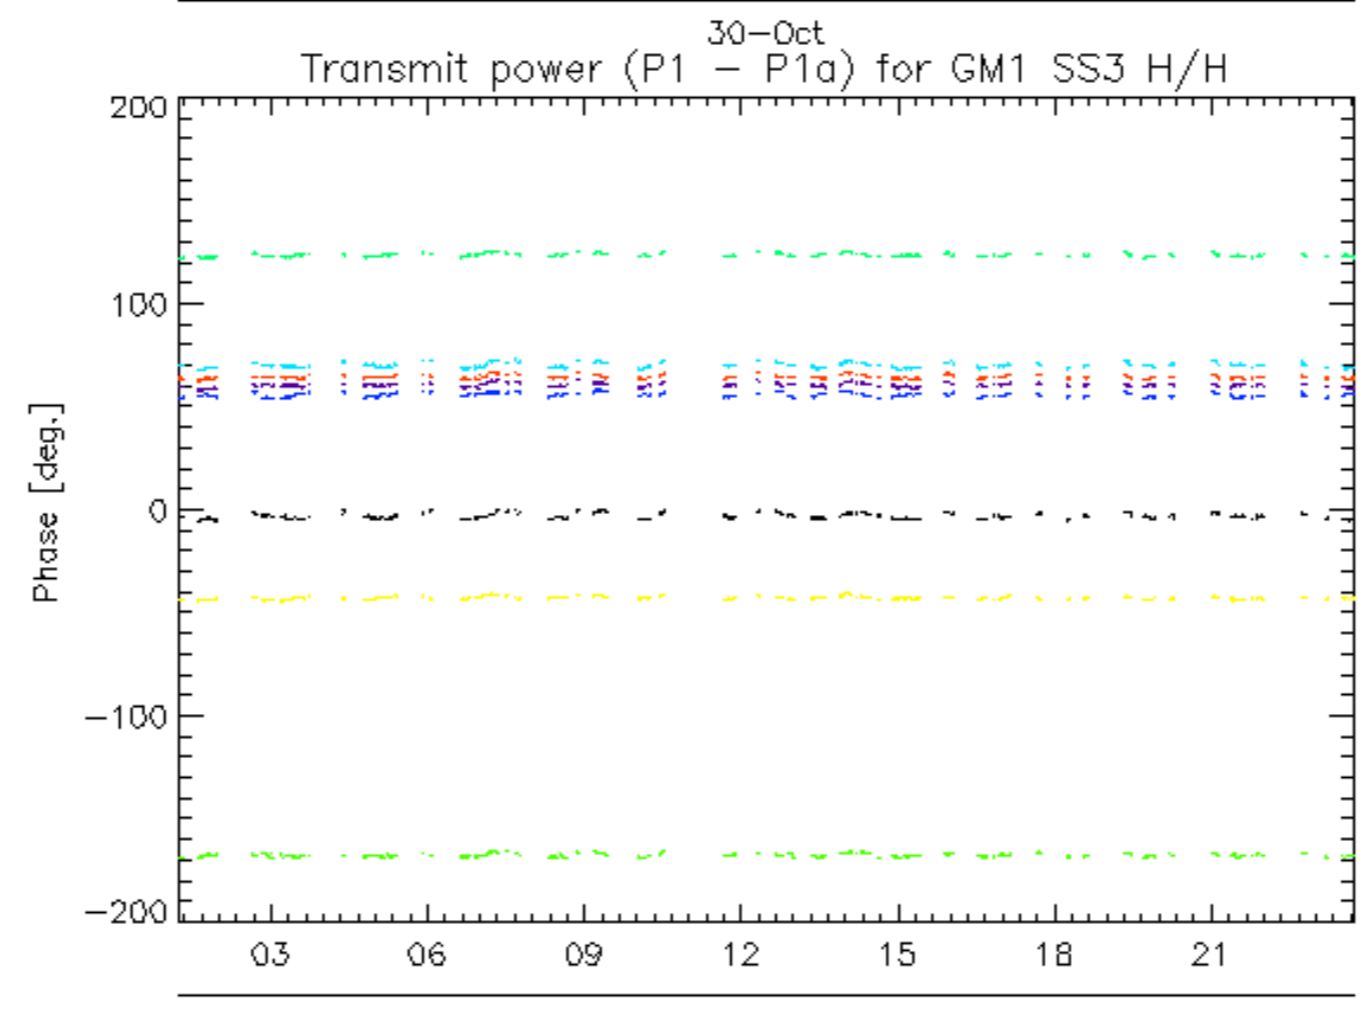
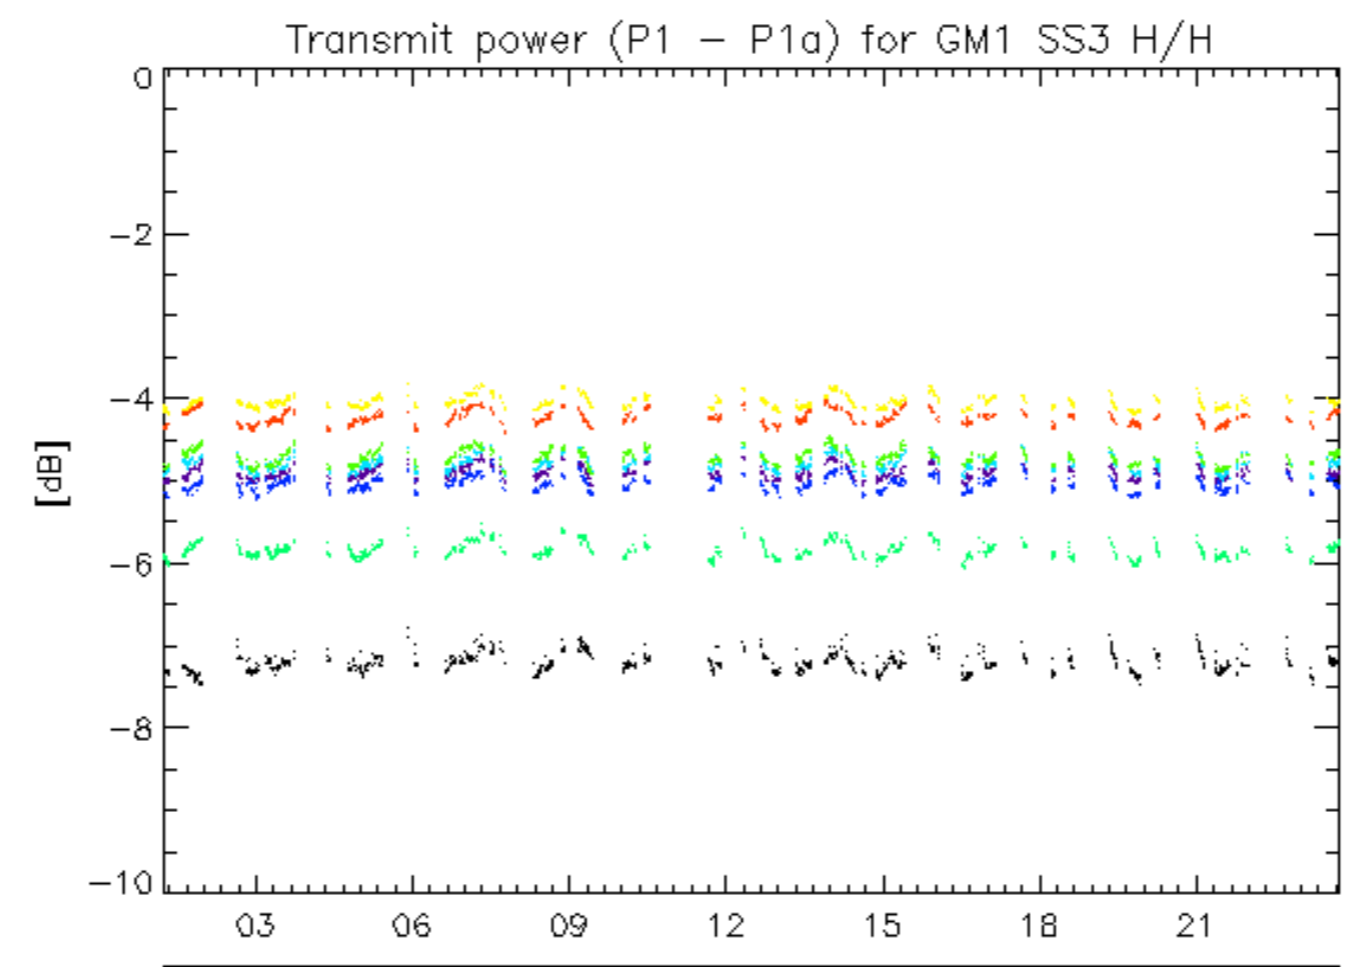




rows: \_ 1 \_ 5 \_ 9 \_ 13 \_ 17 \_ 21 \_ 25 \_ 29

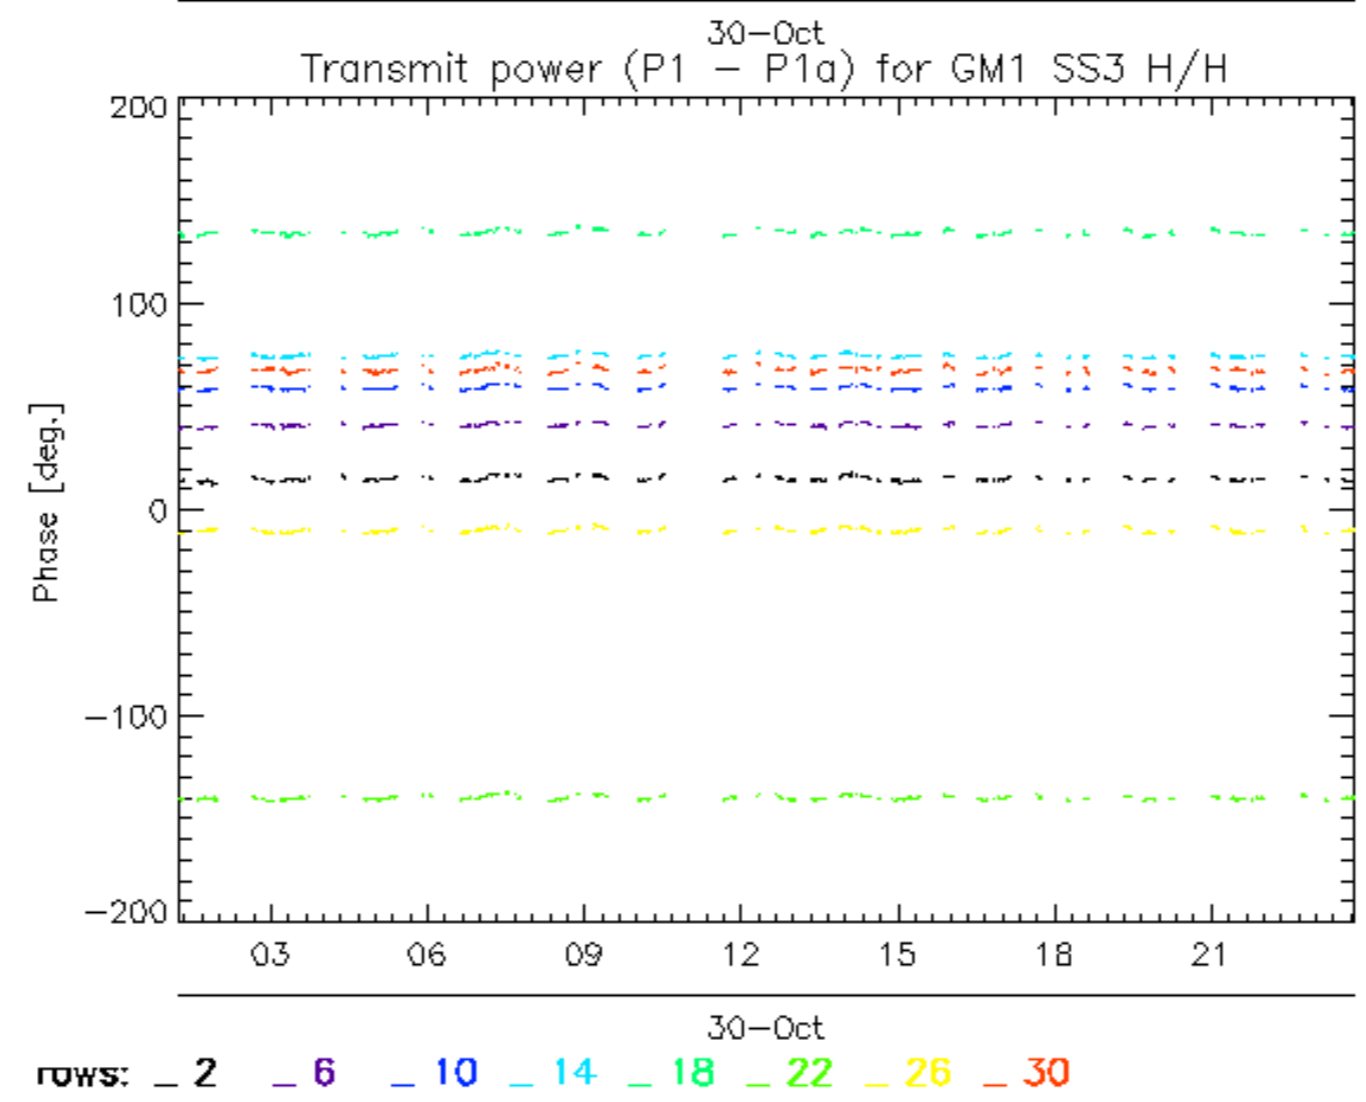
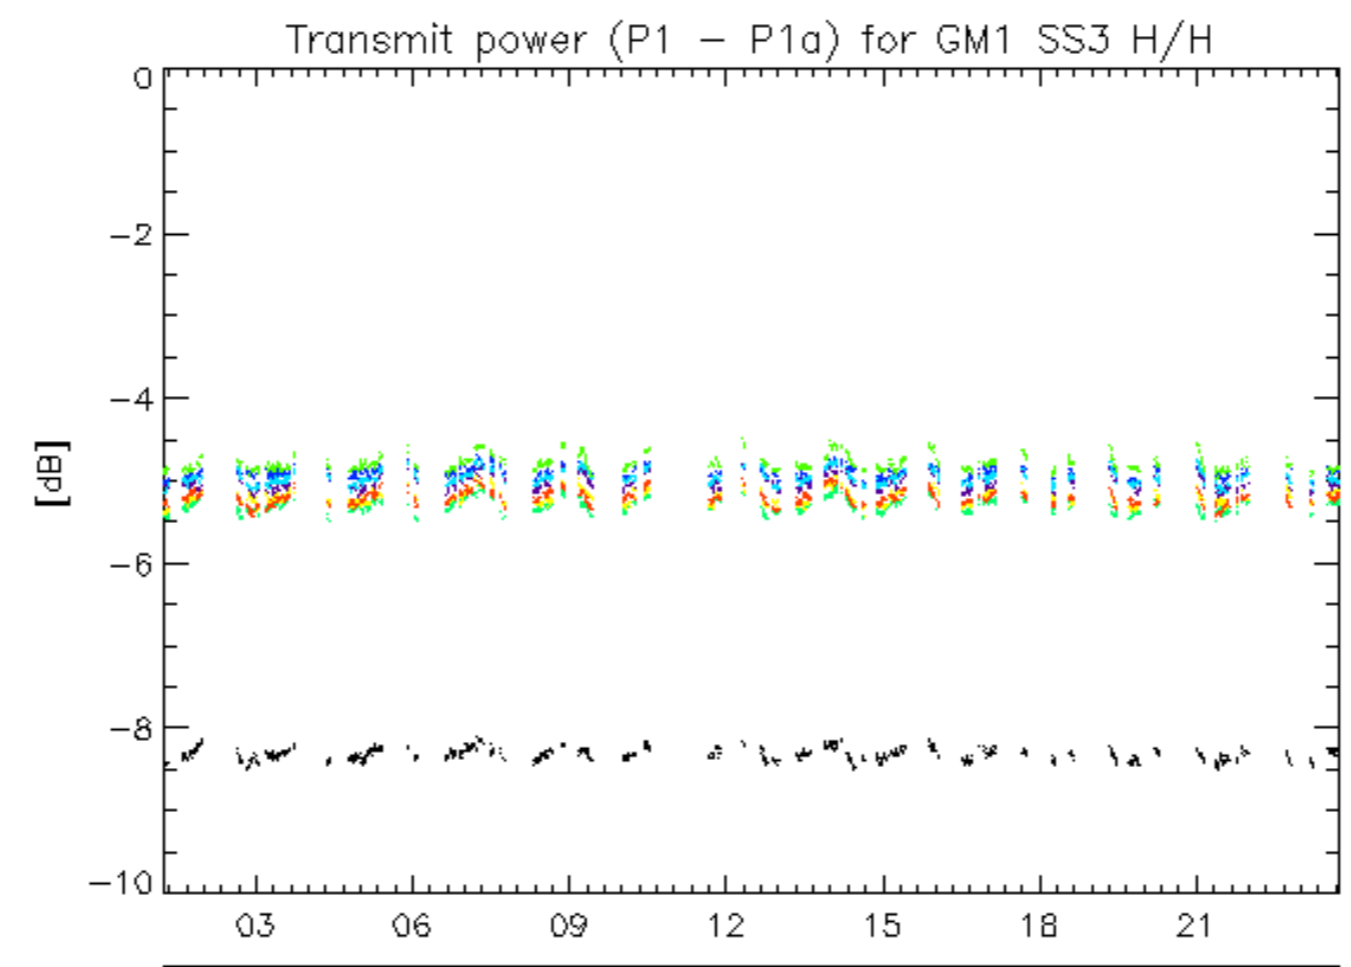


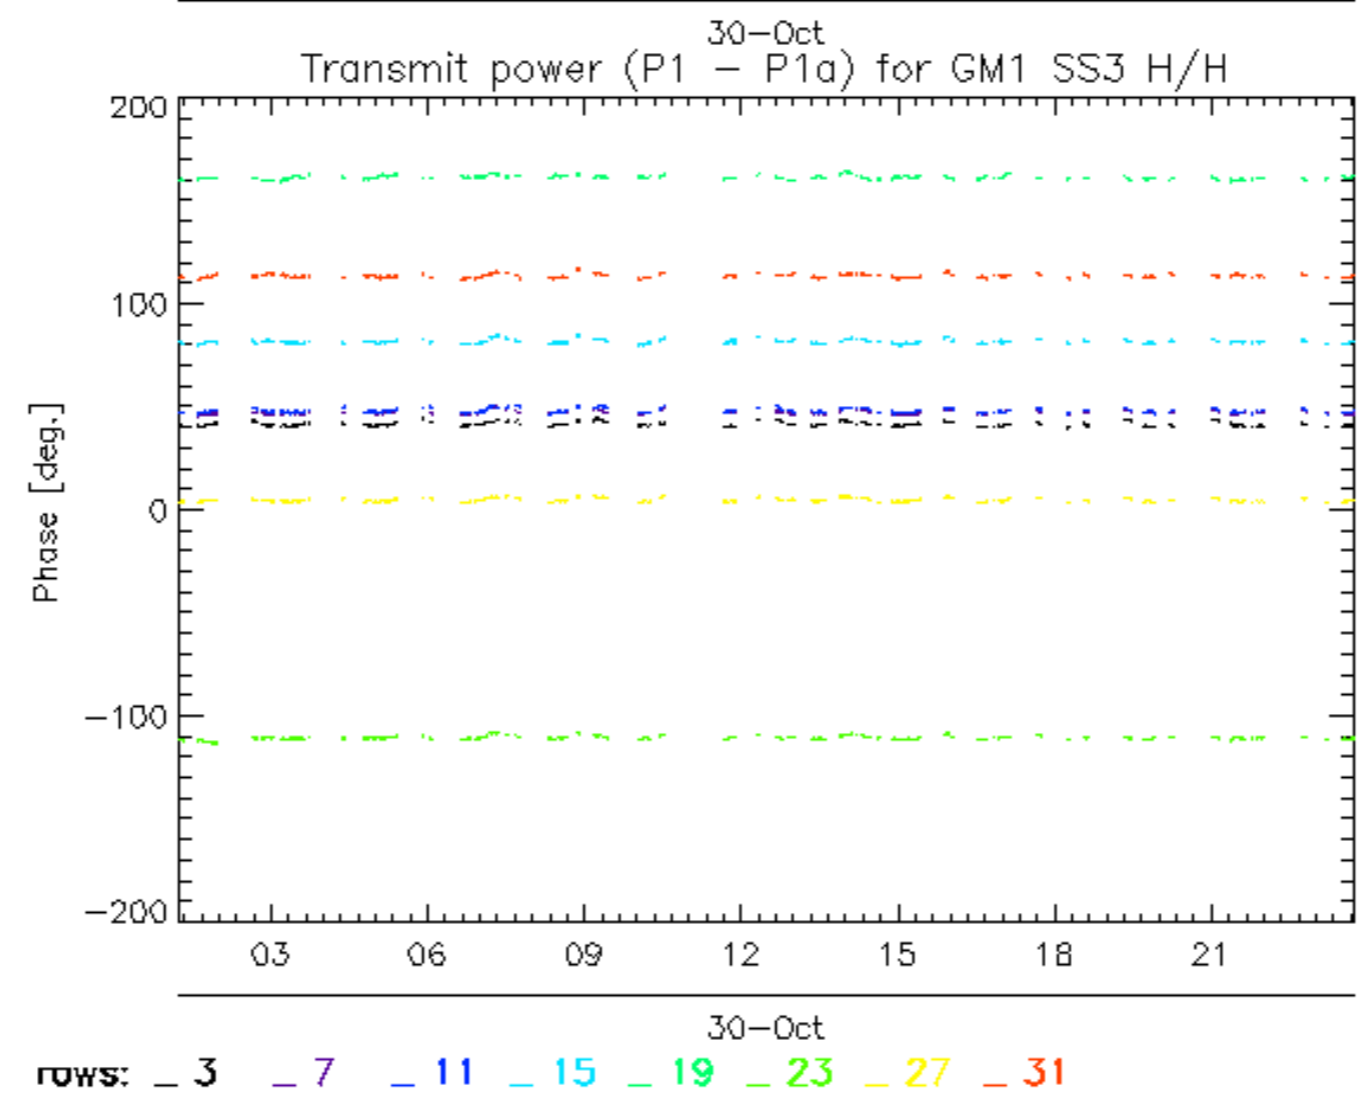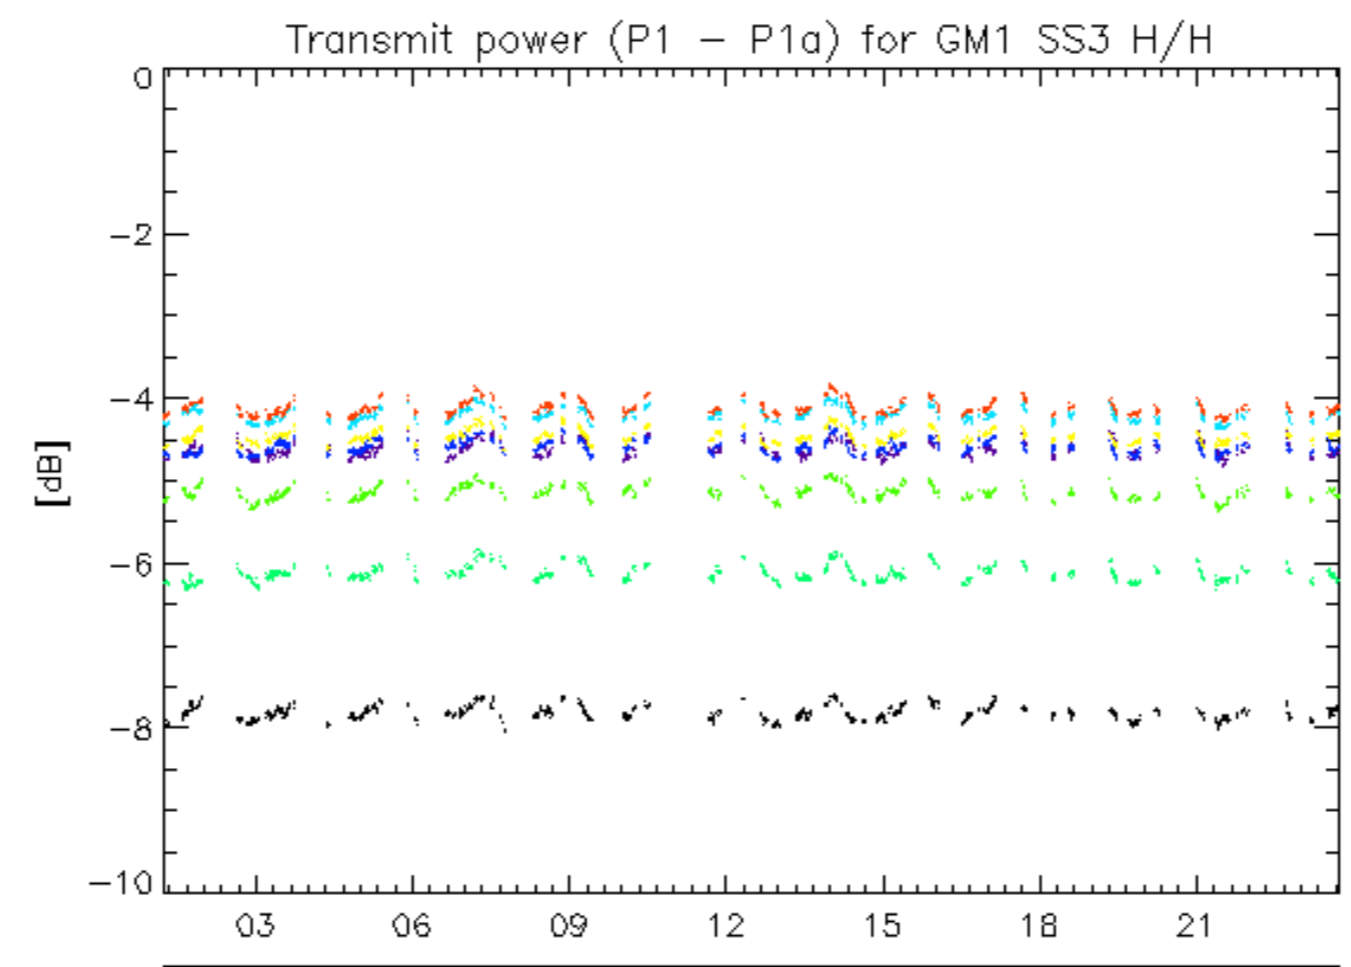





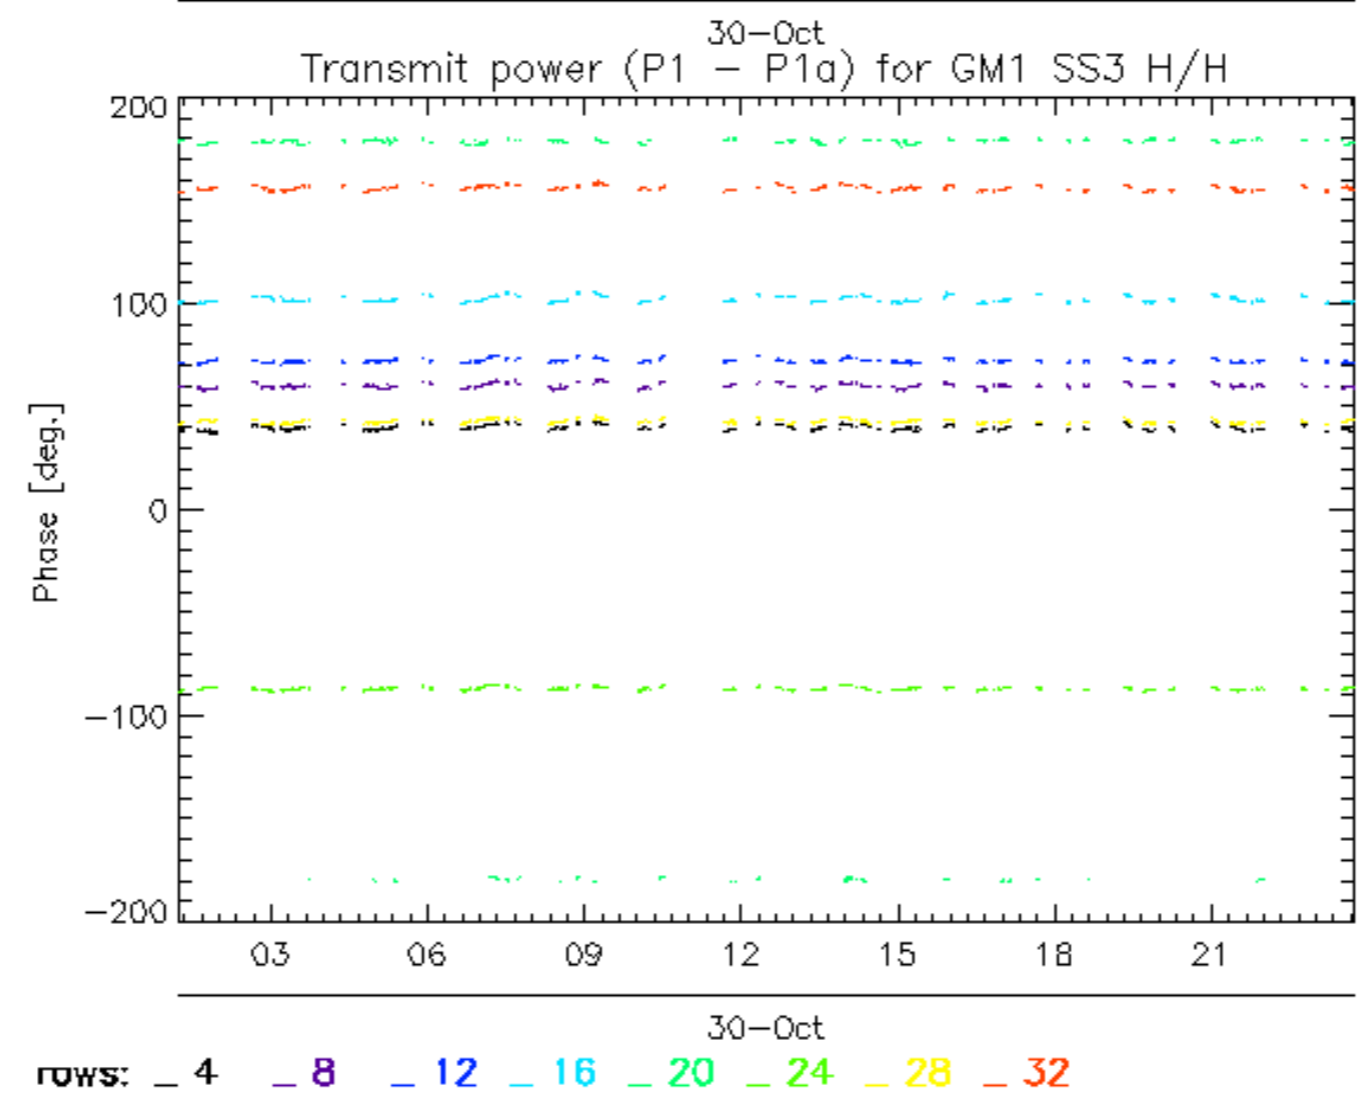
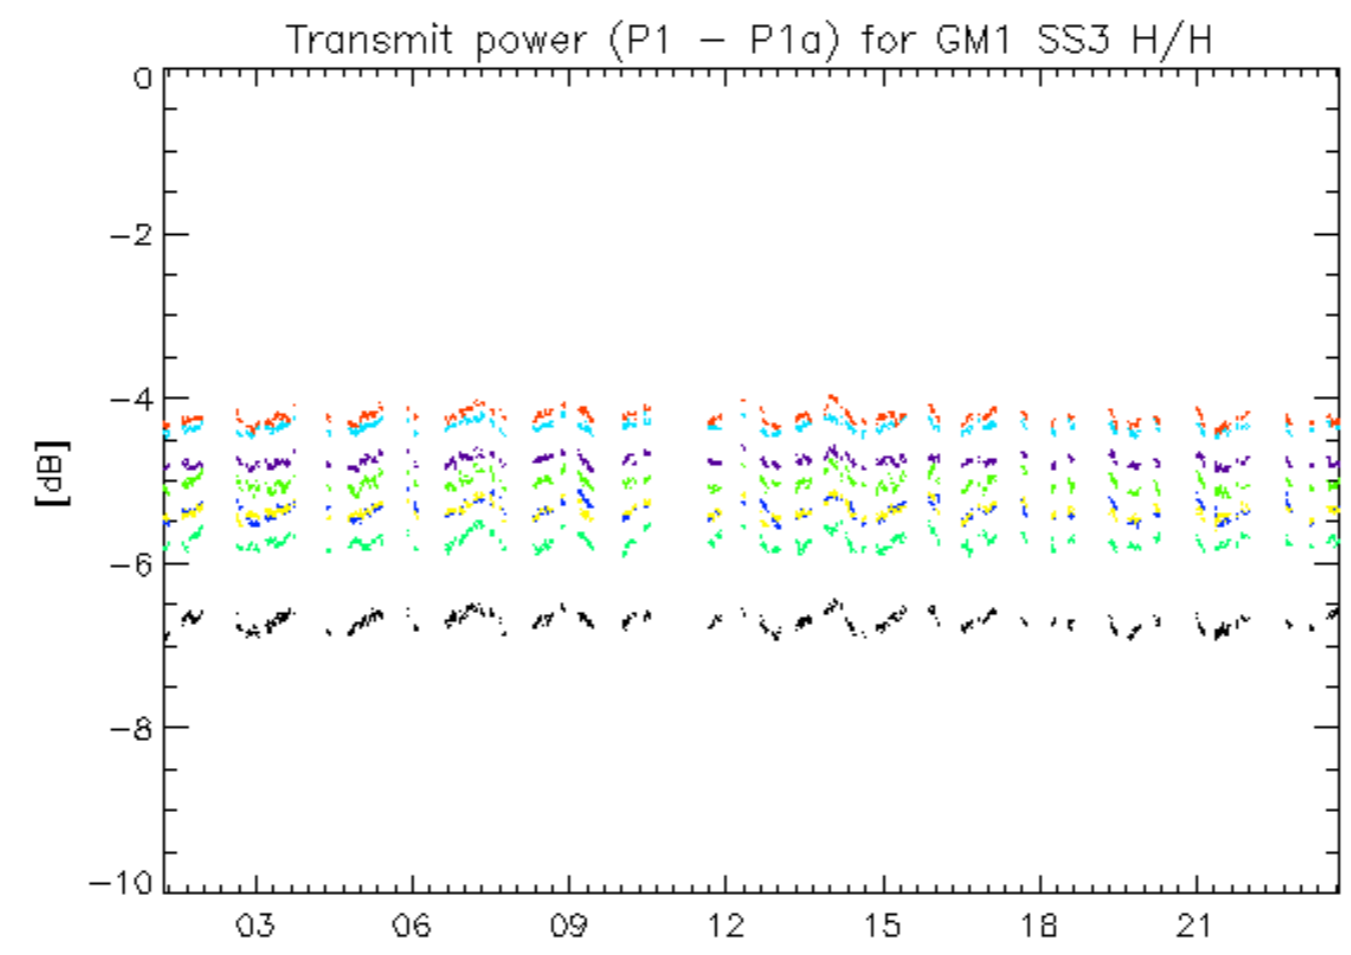


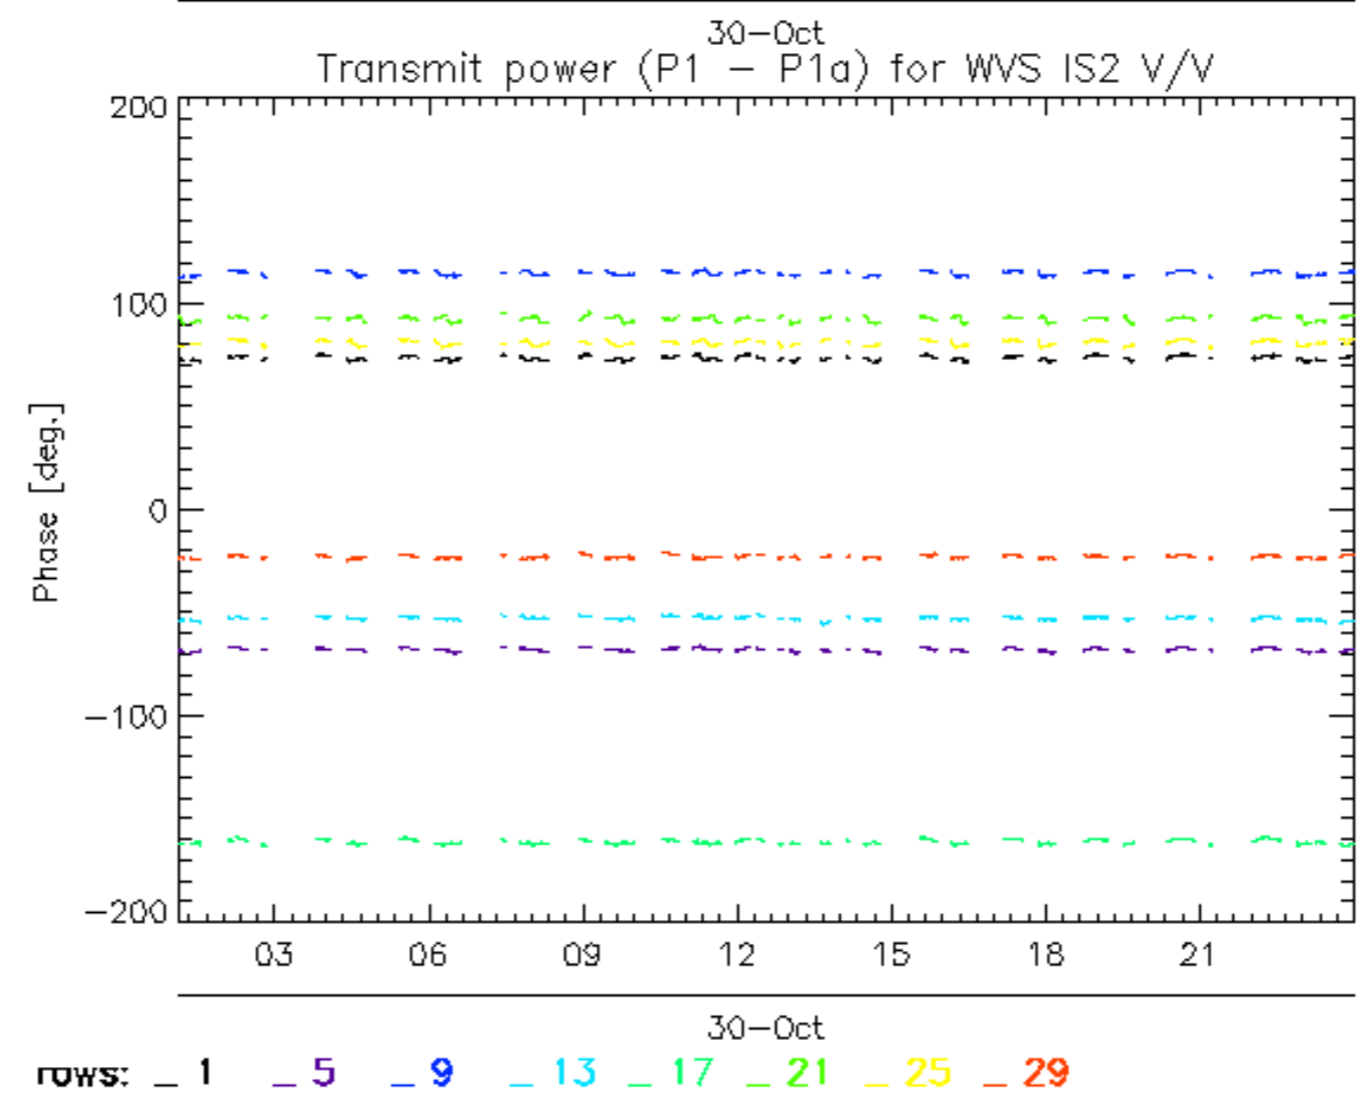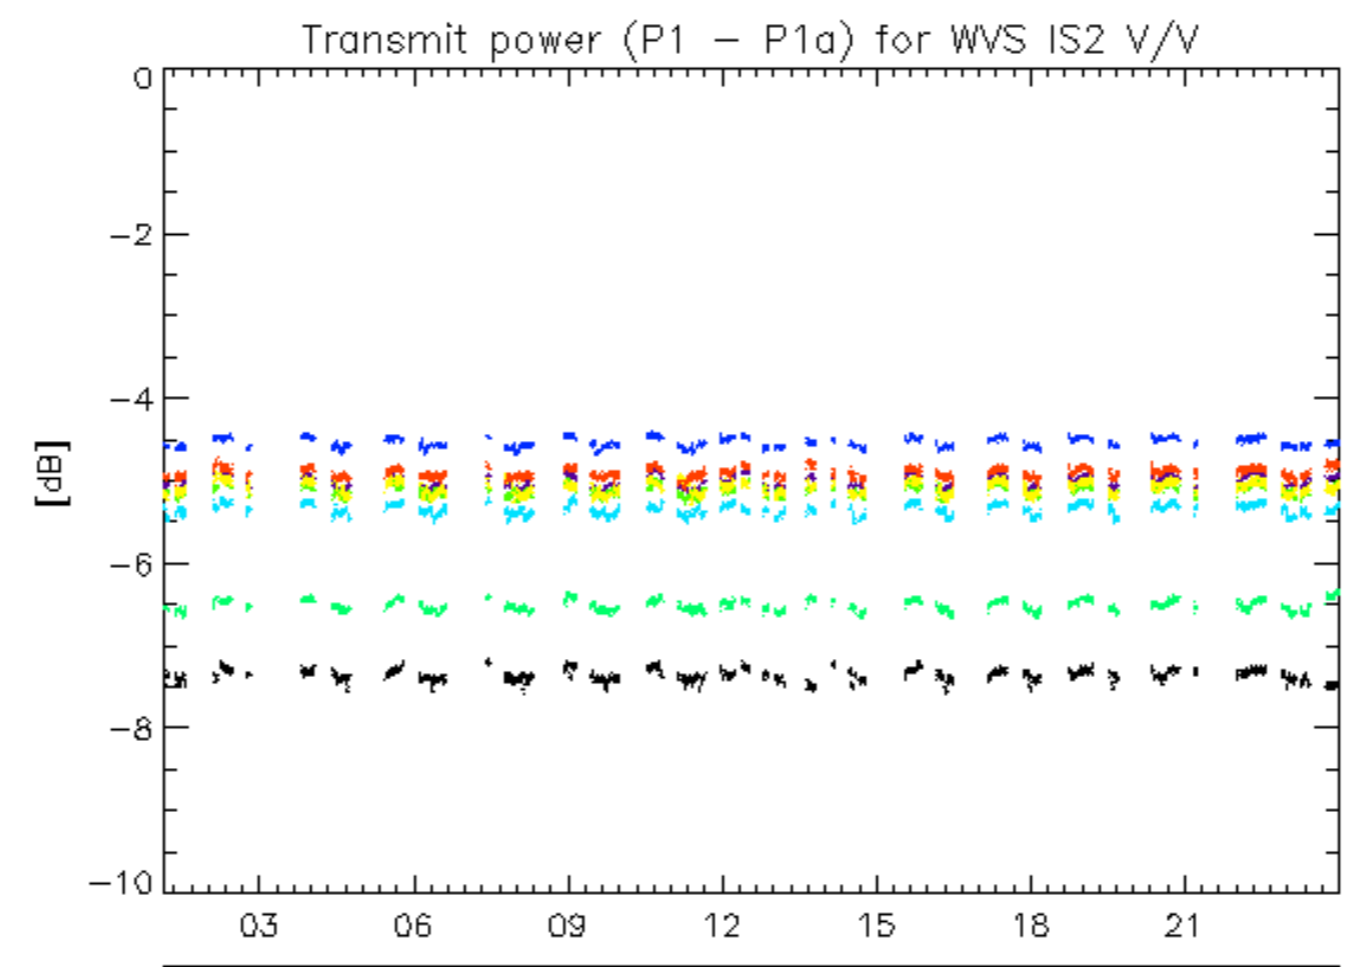


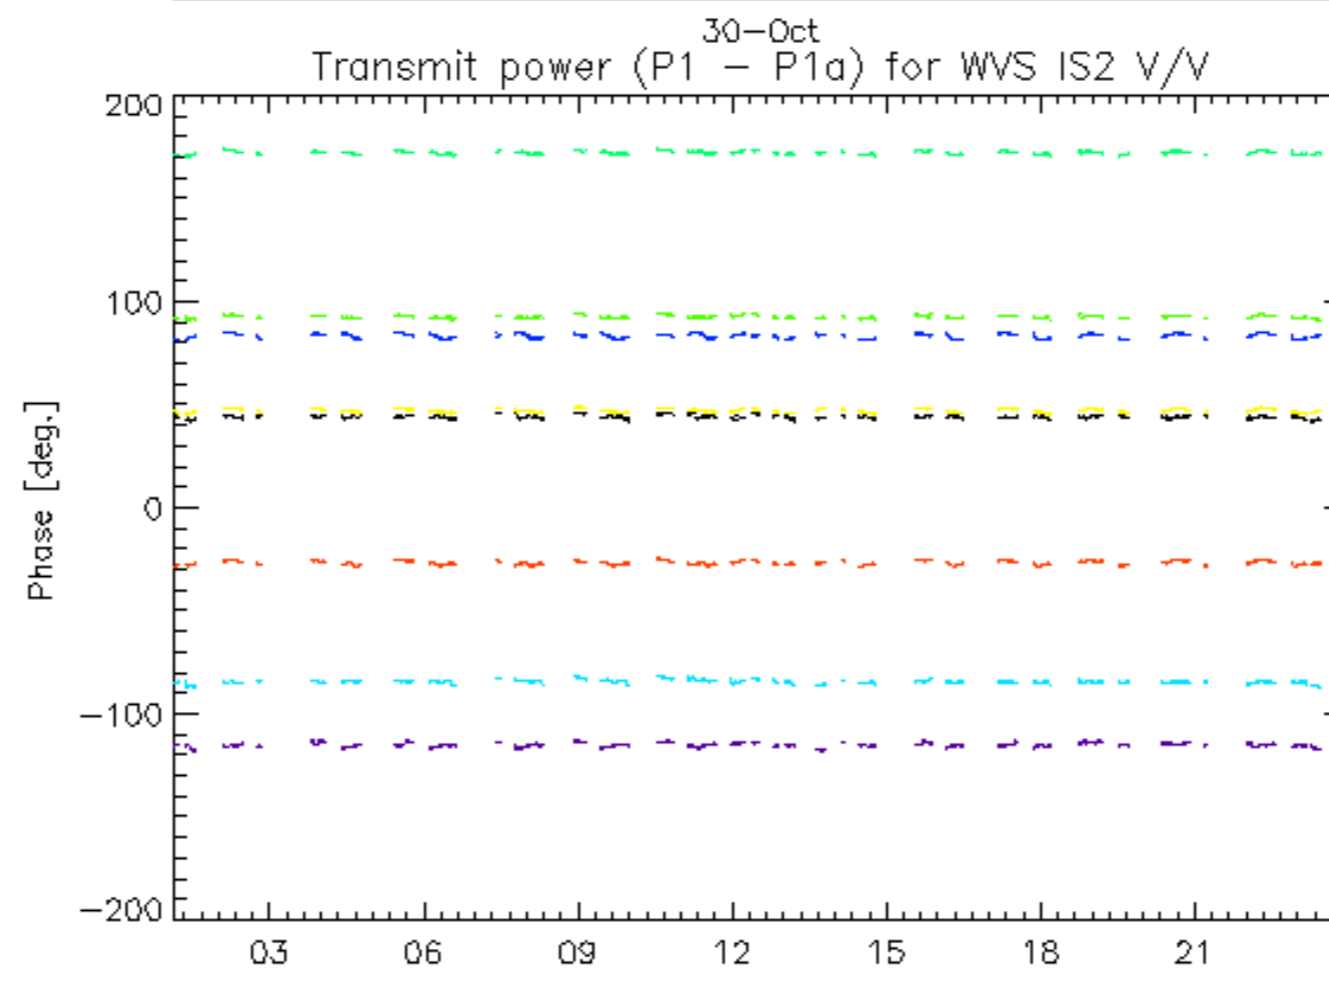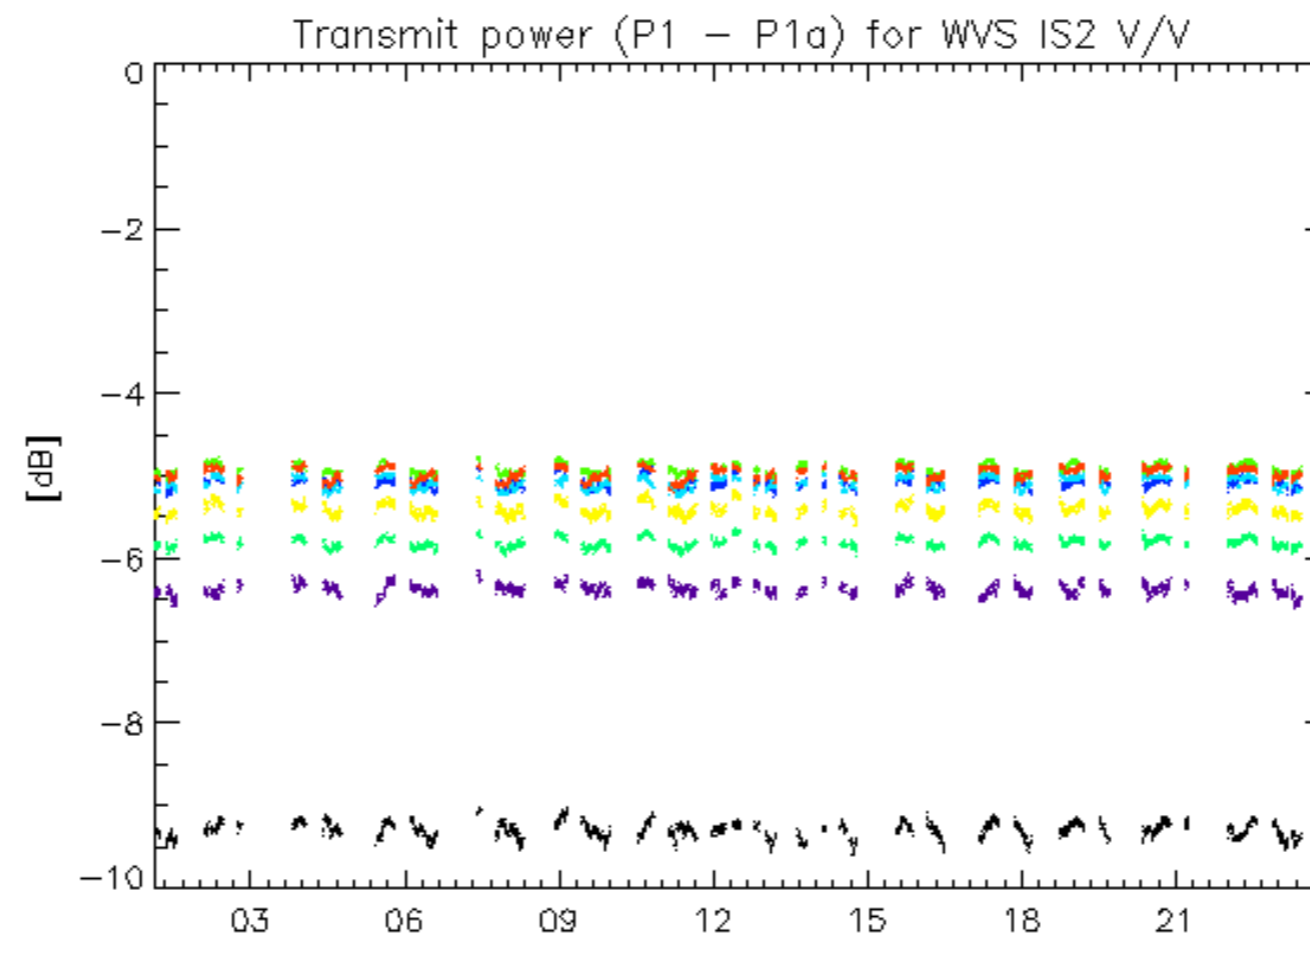



30-Oct  
rows: \_ 2 \_ 6 \_ 10 \_ 14 \_ 18 \_ 22 \_ 26 \_ 30

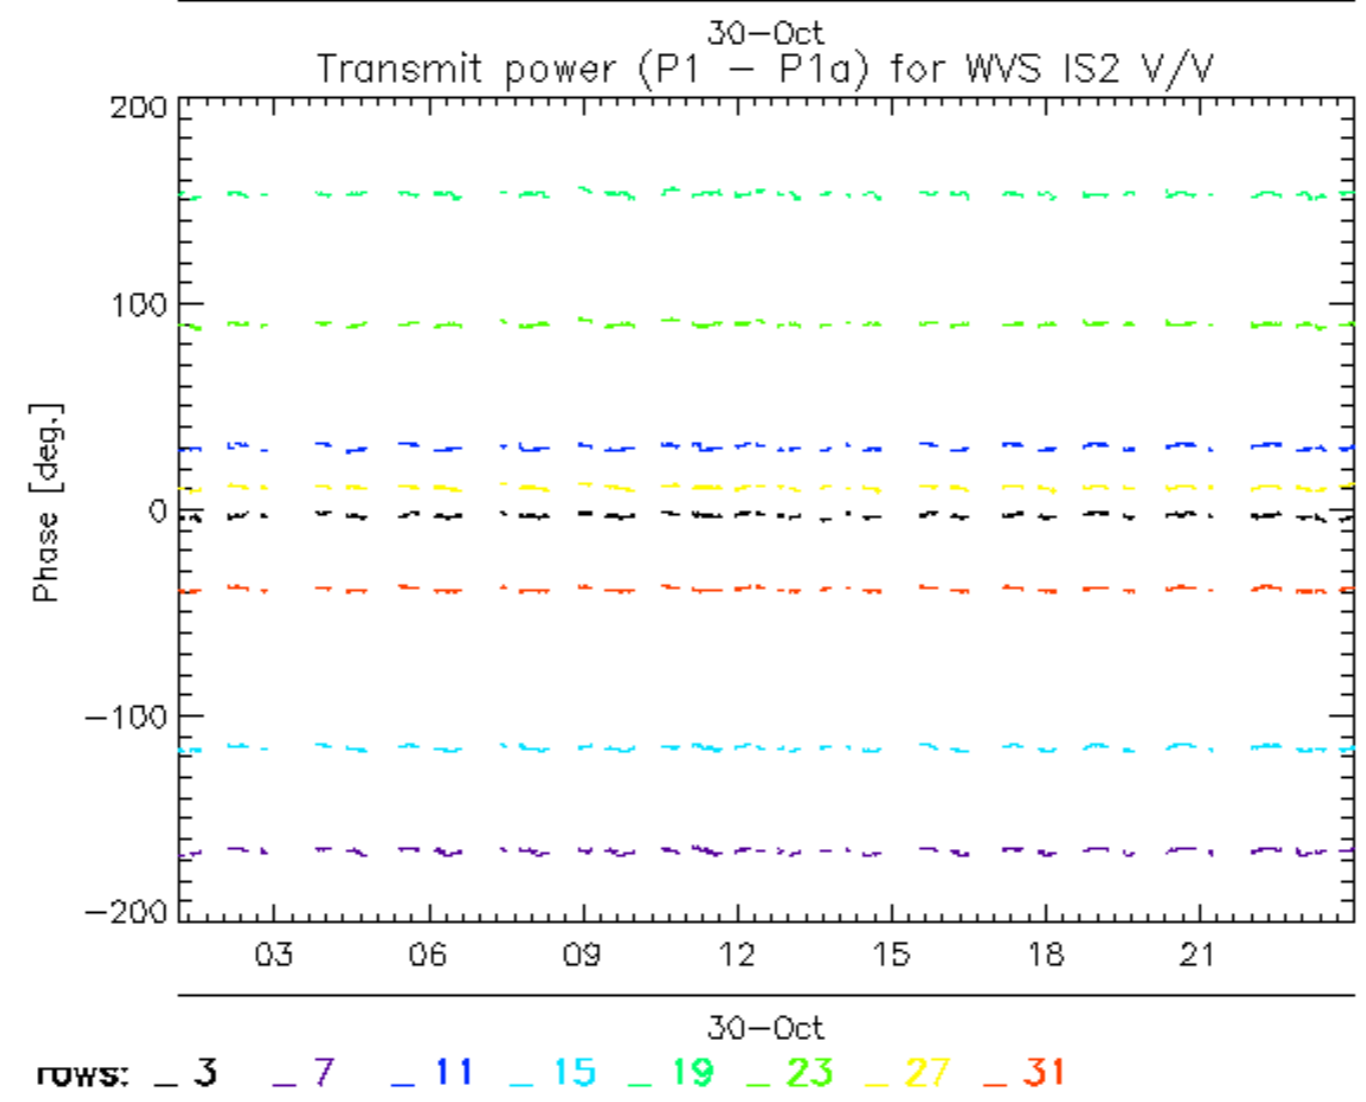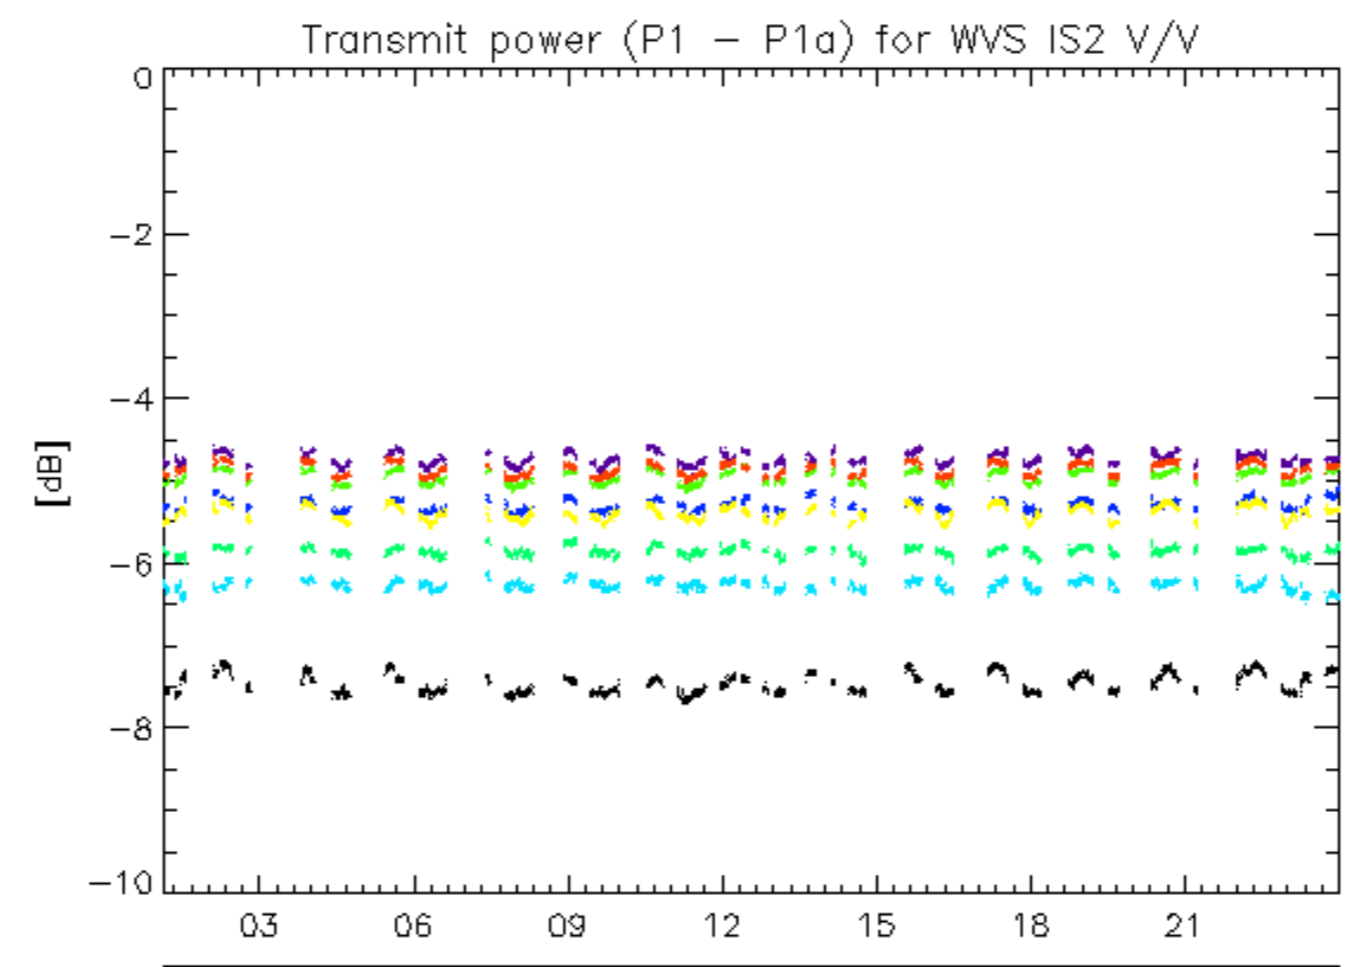

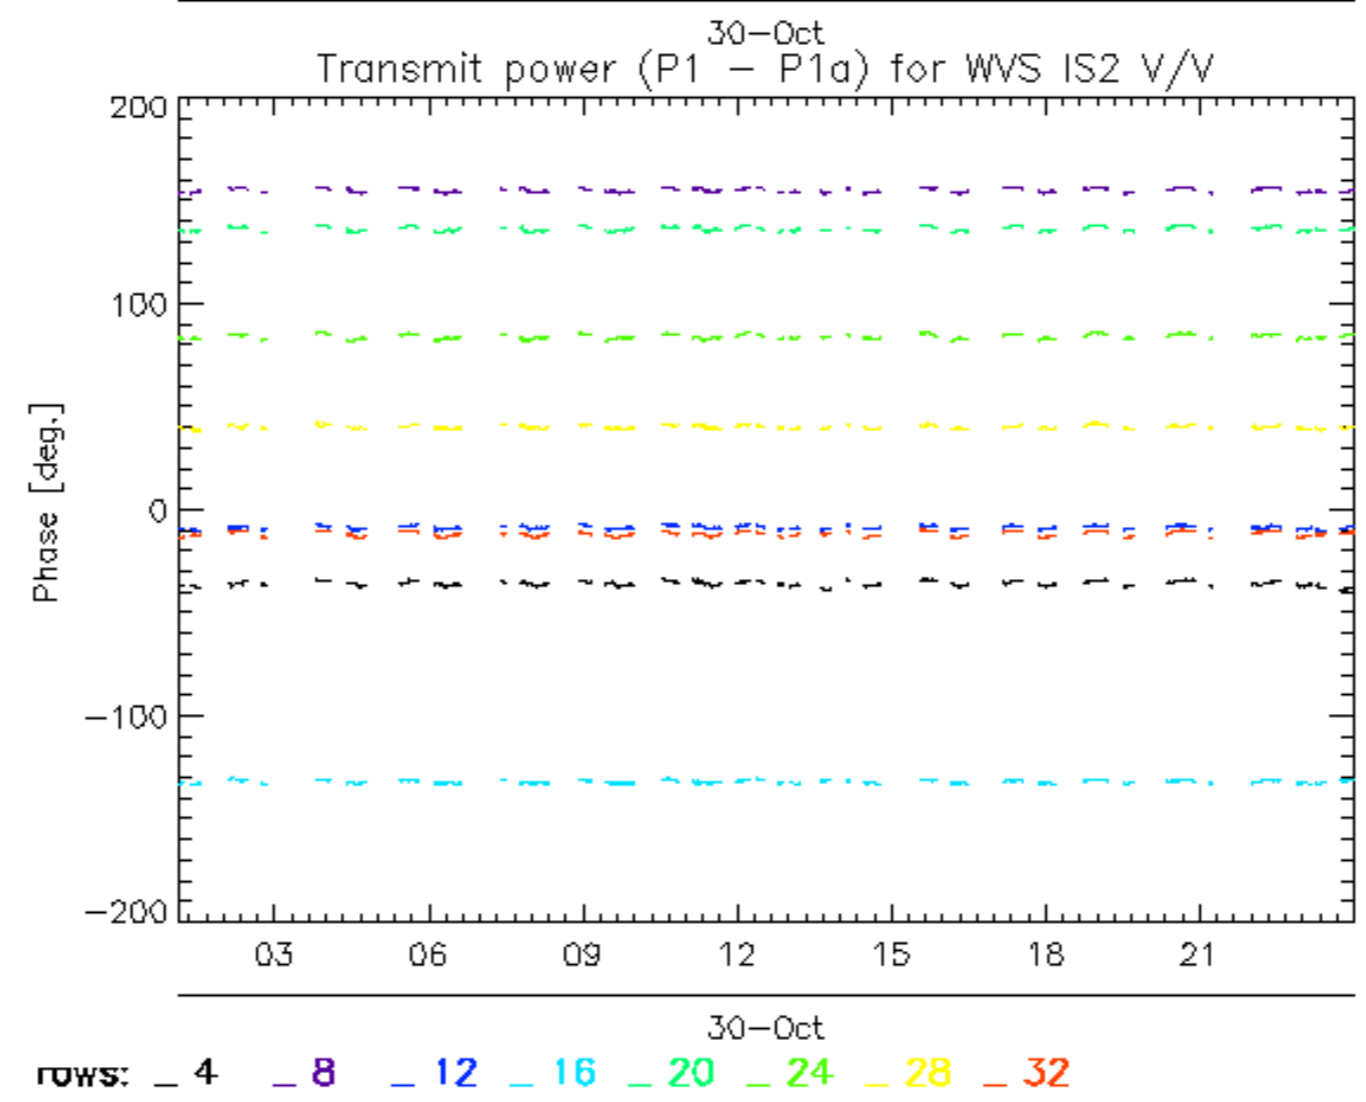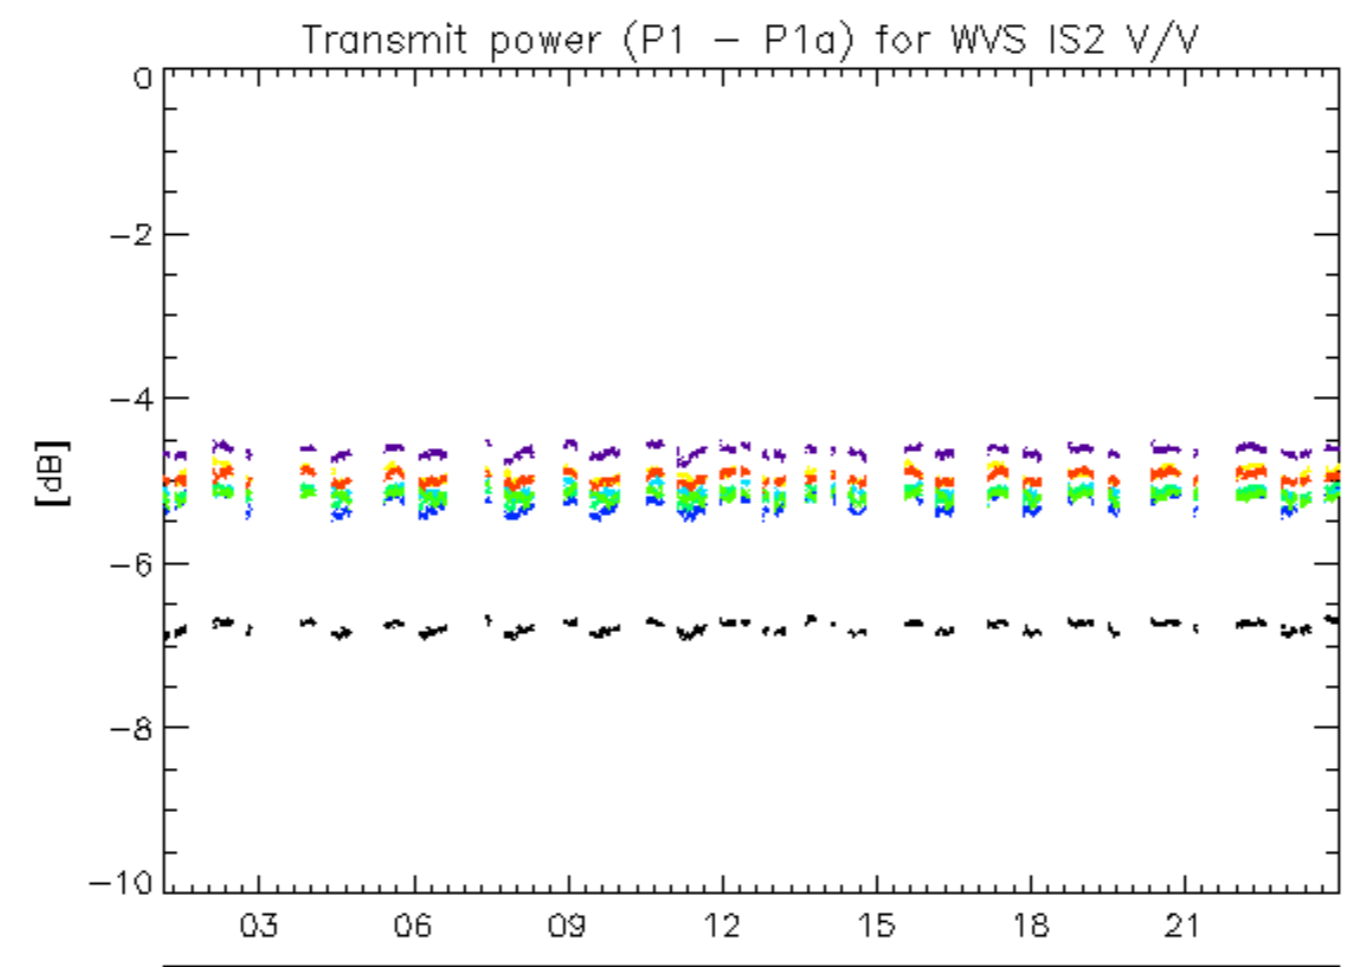


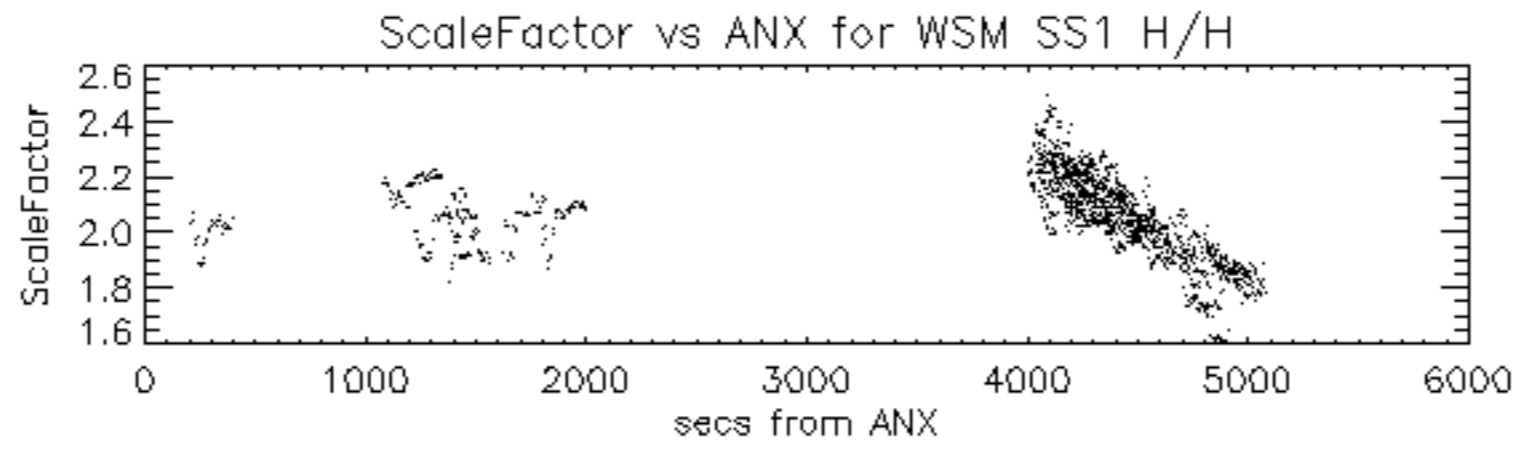

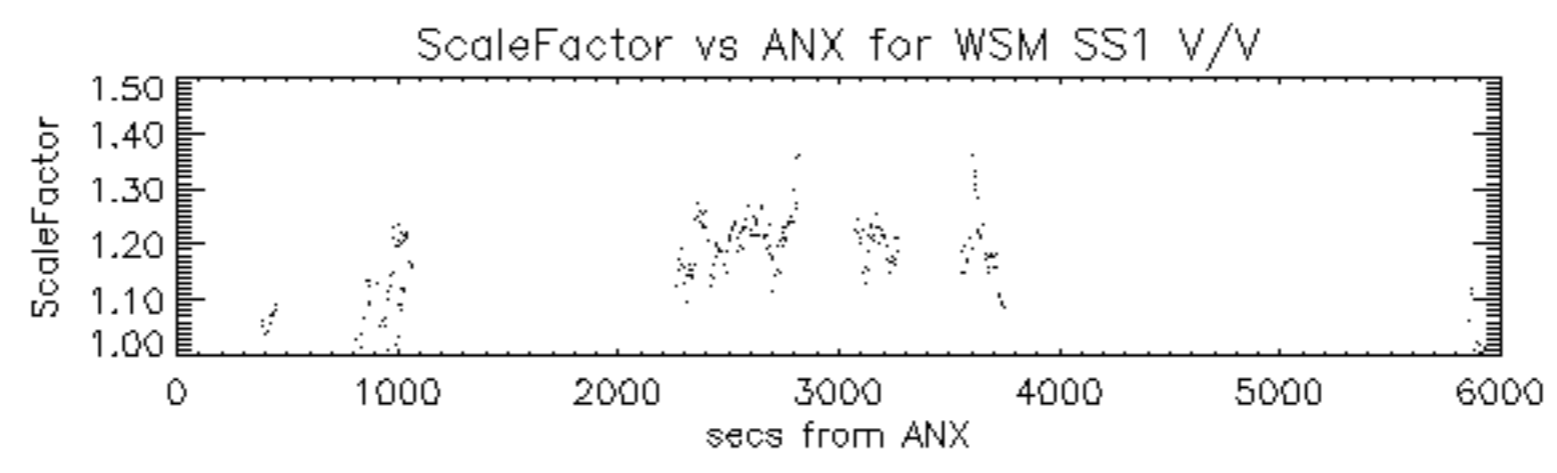

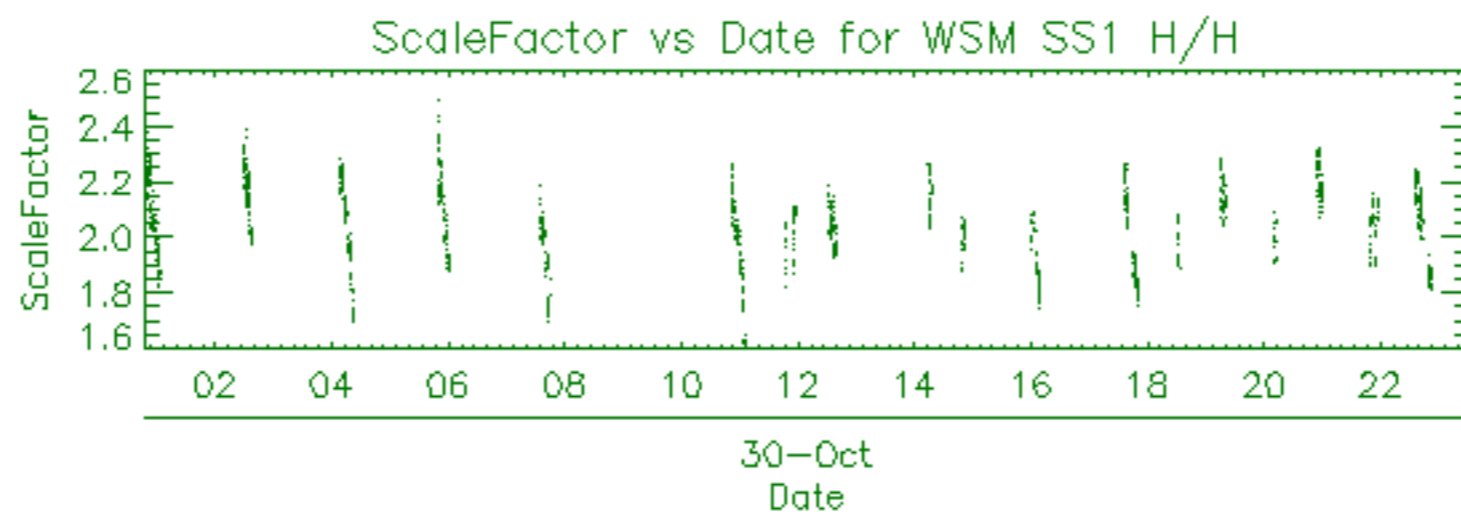



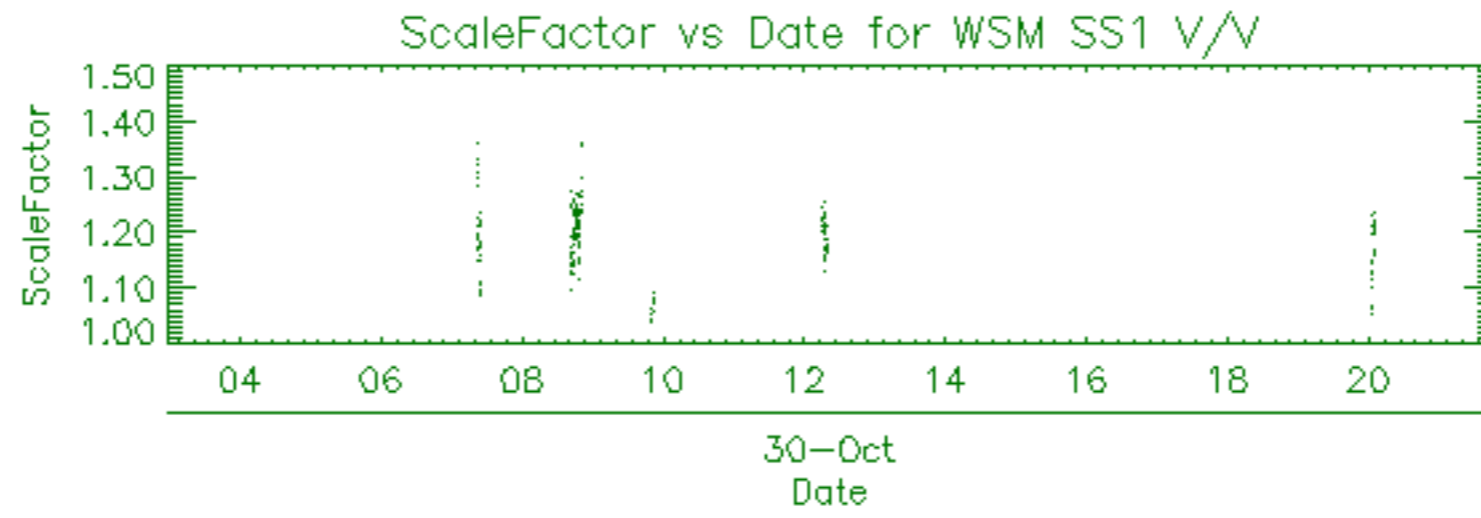

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_APM_1PNPDE20071030_020140_000000862063_00003_29616_6035.N1						IS2	H/H	63	29616	3	4.04
ASA_APM_1PNPDE20071030_020140_000000862063_00003_29616_6639.N1						IS2	H/H	63	29616	3	4.04
ASA_APM_1PNPDE20071030_020140_000000862063_00003_29616_7149.N1						IS2	H/H	63	29616	3	4.04
ASA_APM_1PNPDE20071030_020140_000000862063_00003_29616_7406.N1						IS2	H/H	63	29616	3	4.04
ASA_APM_1PNPDE20071030_020332_000001462063_00003_29616_6037.N1						IS2	V/V	63	29616	3	4.04
ASA_APM_1PNPDE20071030_020332_000001462063_00003_29616_6637.N1						IS2	V/V	63	29616	3	4.04
ASA_APM_1PNPDE20071030_020332_000001462063_00003_29616_7125.N1						IS2	V/V	63	29616	3	4.04
ASA_APM_1PNPDE20071030_020332_000001462063_00003_29616_7364.N1						IS2	V/V	63	29616	3	4.04
ASA_APM_1PNPDE20071030_021119_000000562063_00003_29616_5810.N1						IS2	V/H	63	29616	3	4.04
ASA_APM_1PNPDE20071030_021119_000000562063_00003_29616_6434.N1						IS2	V/H	63	29616	3	4.04
ASA_APM_1PNPDE20071030_021119_000000562063_00003_29616_6714.N1						IS2	V/H	63	29616	3	4.04
ASA_APM_1PNPDE20071030_021119_000000562063_00003_29616_6960.N1						IS2	V/H	63	29616	3	4.04
ASA_APM_1PNPDE20071030_033936_000001462063_00004_29617_6700.N1						IS2	H/V	63	29617	4	4.04
ASA_APM_1PNPDE20071030_033936_000001462063_00004_29617_6760.N1						IS2	H/V	63	29617	4	4.04
ASA_APM_1PNPDE20071030_053807_000000402063_00005_29618_5542.N1						IS7	H/H	63	29618	5	4.04
ASA_APM_1PNPDE20071030_064210_000000402063_00006_29619_5411.N1						IS2	H/H	63	29619	6	4.04
ASA_APM_1PNPDK20071030_131602_000002522063_00010_29623_3645.N1						IS1	H/V	63	29623	10	4.05
ASA_APM_1PNPDK20071030_131704_000001902063_00010_29623_3628.N1						IS1	H/V	63	29623	10	4.05
ASA_APM_1PNPDE20071030_163417_000000402063_00012_29625_7267.N1						IS2	H/H	63	29625	12	4.04
ASA_APM_1PNPDE20071030_163417_000000402063_00012_29625_7427.N1						IS2	H/H	63	29625	12	4.04



ASA_GM1_1PNPDK20071030_141228_000000962063_00010_29623_3772.N1	SS1	H/H	63	29623	10	4.05
ASA_GM1_1PNPDK20071030_141747_000006342063_00010_29623_3672.N1	SS1	H/H	63	29623	10	4.05
ASA_GM1_1PNPDK20071030_143540_000002352063_00010_29623_3782.N1	SS1	H/H	63	29623	10	4.05
ASA_GM1_1PNPDK20071030_145230_000007002063_00011_29624_3679.N1	SS1	H/H	63	29624	11	4.05
ASA_GM1_1PNPDK20071030_150650_000000662063_00011_29624_3686.N1	SS1	H/H	63	29624	11	4.05
ASA_GM1_1PNPDK20071030_150936_000004772063_00011_29624_3802.N1	SS1	H/H	63	29624	11	4.05
ASA_GM1_1PNPDK20071030_151918_000002112063_00011_29624_3804.N1	SS1	H/H	63	29624	11	4.05
ASA_GM1_1PNPDK20071030_152345_000001022063_00011_29624_3806.N1	SS1	H/H	63	29624	11	4.05
ASA_GM1_1PNPDK20071030_155304_000004472063_00011_29624_3808.N1	SS1	H/H	63	29624	11	4.05
ASA_GM1_1PNPDK20071030_160214_000001932063_00011_29624_3813.N1	SS1	H/H	63	29624	11	4.05
ASA_GM1_1PNPDK20071030_163048_000002052063_00012_29625_3815.N1	SS1	H/H	63	29625	12	4.05
ASA_GM1_1PNPDK20071030_163524_000004472063_00012_29625_3822.N1	SS1	H/H	63	29625	12	4.05
ASA_GM1_1PNPDK20071030_165013_000000722063_00012_29625_3937.N1	SS1	H/H	63	29625	12	4.05
ASA_GM1_1PNPDK20071030_165608_000008452063_00012_29625_3939.N1	SS1	H/H	63	29625	12	4.05
ASA_GM1_1PNPDK20071030_174029_000002772063_00012_29625_3944.N1	SS1	H/H	63	29625	12	4.05
ASA_GM1_1PNPDK20071030_181328_000003382063_00013_29626_3954.N1	SS1	H/H	63	29626	13	4.05
ASA_GM1_1PNPDK20071030_183307_000003982063_00013_29626_4059.N1	SS1	H/H	63	29626	13	4.05
ASA_GM1_1PNPDK20071030_192105_000005492063_00013_29626_4061.N1	SS1	H/H	63	29626	13	4.05
ASA_GM1_1PNPDK20071030_194243_000007672063_00013_29626_4071.N1	SS1	H/H	63	29626	13	4.05
ASA_GM1_1PNPDE20071030_201239_000003502063_00014_29627_7507.N1	SS1	H/H	63	29627	14	4.04
ASA_GM1_1PNPDE20071030_201239_000003502063_00014_29627_7599.N1	SS1	H/H	63	29627	14	4.04
ASA_GM1_1PNPDE20071030_210125_000005612063_00014_29627_7514.N1	SS1	H/H	63	29627	14	4.04
ASA_GM1_1PNPDE20071030_210125_000005612063_00014_29627_7666.N1	SS1	H/H	63	29627	14	4.04
ASA_GM1_1PNPDE20071030_212117_000010082063_00014_29627_8119.N1	SS1	H/H	63	29627	14	4.04
ASA_GM1_1PNPDE20071030_214602_000001262063_00015_29628_7827.N1	SS1	H/H	63	29628	15	4.04
ASA_GM1_1PNPDE20071030_215236_000001322063_00015_29628_7780.N1	SS1	H/H	63	29628	15	4.04
ASA_GM1_1PNPDE20071030_215833_000001022063_00015_29628_7881.N1	SS1	H/H	63	29628	15	4.04
ASA_GM1_1PNPDE20071030_215833_000001022063_00015_29628_7969.N1	SS1	H/H	63	29628	15	4.04
ASA_GM1_1PNPDE20071030_224338_000003022063_00015_29628_7889.N1	SS1	H/H	63	29628	15	4.04
ASA_GM1_1PNPDE20071030_224338_000003022063_00015_29628_7977.N1	SS1	H/H	63	29628	15	4.04
ASA_GM1_1PNPDE20071030_231052_000002172063_00016_29629_8101.N1	SS1	H/H	63	29629	16	4.04
ASA_GM1_1PNPDE20071030_233120_000007972063_00016_29629_8123.N1	SS1	H/H	63	29629	16	4.04

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20071030_021305_000000342063_00003_29616_5808.N1						IS3	V/V	63	29616	3	4.04
ASA_IMM_1PNPDE20071030_021305_000000342063_00003_29616_6424.N1						IS3	V/V	63	29616	3	4.04
ASA_IMM_1PNPDE20071030_021305_000000342063_00003_29616_6460.N1						IS3	V/V	63	29616	3	4.04
ASA_IMM_1PNPDE20071030_021305_000000342063_00003_29616_6682.N1						IS3	V/V	63	29616	3	4.04
ASA_IMM_1PNPDE20071030_032157_000000372063_00004_29617_5935.N1						IS5	V/V	63	29617	4	4.04
ASA_IMM_1PNPDE20071030_032157_000000372063_00004_29617_7025.N1						IS5	V/V	63	29617	4	4.04
ASA_IMM_1PNPDE20071030_034422_000000802063_00004_29617_6374.N1						IS2	V/V	63	29617	4	4.04
ASA_IMM_1PNPDE20071030_034422_000000802063_00004_29617_6698.N1						IS2	V/V	63	29617	4	4.04
ASA_IMM_1PNPDE20071030_034739_000000812063_00004_29617_6348.N1						IS2	V/V	63	29617	4	4.04
ASA_IMM_1PNPDE20071030_034739_000000812063_00004_29617_6696.N1						IS2	V/V	63	29617	4	4.04
ASA_IMM_1PNPDE20071030_045721_000000652063_00005_29618_5720.N1						IS3	V/V	63	29618	5	4.04
ASA_IMM_1PNPDE20071030_051111_000001402063_00005_29618_5975.N1						IS2	V/V	63	29618	5	4.04
ASA_IMM_1PNPDE20071030_051111_000001402063_00005_29618_6495.N1						IS2	V/V	63	29618	5	4.04
ASA_IMM_1PNPDE20071030_051937_000000802063_00005_29618_6029.N1						IS2	V/V	63	29618	5	4.04
ASA_IMM_1PNPDE20071030_051937_000000802063_00005_29618_7404.N1						IS2	V/V	63	29618	5	4.04
ASA_IMM_1PNPDK20071030_065046_000001422063_00006_29619_3140.N1						IS2	V/V	63	29619	6	4.04
ASA_IMM_1PNPDE20071030_065920_000000802063_00006_29619_5538.N1						IS2	V/V	63	29619	6	4.04
ASA_IMM_1PNPDE20071030_070834_000001402063_00006_29619_5536.N1						IS2	V/V	63	29619	6	4.04
ASA_IMM_1PNPDE20071030_071333_000000352063_00006_29619_5398.N1						IS6	V/V	63	29619	6	4.04
ASA_IMM_1PNPDE20071030_071602_000000782063_00006_29619_5540.N1						IS4	H/H	63	29619	6	4.04
ASA_IMM_1PNPDK20071030_082937_000001212063_00007_29620_3234.N1						IS2	V/V	63	29620	7	4.05
ASA_IMM_1PNPDK20071030_100958_000002002063_00008_29621_3360.N1						IS2	V/V	63	29621	8	4.05
ASA_IMM_1PNPDK20071030_101558_000002772063_00008_29621_3376.N1						IS2	V/V	63	29621	8	4.05
ASA_IMM_1PNPDK20071030_101700_000002152063_00008_29621_3372.N1						IS2	V/V	63	29621	8	4.05
ASA_IMM_1PNPDE20071030_111125_000000982063_00008_29621_6291.N1						IS2	V/V	63	29621	8	4.04
ASA_IMM_1PNPDK20071030_115104_000000512063_00009_29622_3479.N1						IS2	V/V	63	29622	9	4.05
ASA_IMM_1PNPDE20071030_120324_000000512063_00009_29622_6137.N1						IS2	V/V	63	29622	9	4.04
ASA_IMM_1PNPDK20071030_131449_000000362063_00010_29623_3604.N1						IS1	V/V	63	29623	10	4.05
ASA_IMM_1PNPDE20071030_135703_000000732063_00010_29623_7429.N1						IS6	V/V	63	29623	10	4.04
ASA_IMM_1PNPDE20071030_135703_000000732063_00010_29623_7778.N1						IS6	V/V	63	29623	10	4.04
ASA_IMM_1PNPDK20071030_150413_000001402063_00011_29624_3766.N1						IS2	V/V	63	29624	11	4.05
ASA_IMM_1PNPDK20071030_150759_000000812063_00011_29624_3764.N1						IS2	V/V	63	29624	11	4.05
ASA_IMM_1PNPDE20071030_152251_000000362063_00011_29624_7269.N1						IS2	H/H	63	29624	11	4.04
ASA_IMM_1PNPDE20071030_152251_000000362063_00011_29624_7420.N1						IS2	H/H	63	29624	11	4.04
ASA_IMM_1PNPDE20071030_164249_000000802063_00012_29625_7597.N1						IS2	V/V	63	29625	12	4.04
ASA_IMM_1PNPDE20071030_164249_000000802063_00012_29625_7823.N1						IS2	V/V	63	29625	12	4.04
ASA_IMM_1PNPDK20071030_164346_000000992063_00012_29625_3903.N1						IS2	V/V	63	29625	12	4.05
ASA_IMM_1PNPDK20071030_164535_000002622063_00012_29625_3923.N1						IS2	V/V	63	29625	12	4.05
ASA_IMM_1PNPDK20071030_165127_000000902063_00012_29625_3921.N1						IS2	H/H	63	29625	12	4.05
ASA_IMM_1PNPDE20071030_165222_000001132063_00012_29625_7668.N1						IS2	H/H	63	29625	12	4.04
ASA_IMM_1PNPDE20071030_165222_000001132063_00012_29625_7868.N1						IS2	H/H	63	29625	12	4.04
ASA_IMM_1PNPDE20071030_165513_000000372063_00012_29625_7275.N1						IS7	H/H	63	29625	12	4.04
ASA_IMM_1PNPDE20071030_165513_000000372063_00012_29625_7437.N1						IS7	H/H	63	29625	12	4.04
ASA_IMM_1PNPDE20071030_181231_000000402063_00013_29626_7324.N1						IS2	V/V	63	29626	13	4.04
ASA_IMM_1PNPDE20071030_181231_000000402063_00013_29626_7457.N1						IS2	V/V	63	29626	13	4.04
ASA_IMM_1PNPDE20071030_181908_000000502063_00013_29626_7326.N1						IS6	V/V	63	29626	13	4.04
ASA_IMM_1PNPDE20071030_181908_000000502063_00013_29626_7447.N1						IS6	V/V	63	29626	13	4.04
ASA_IMM_1PNPDK20071030_182024_000005942063_00013_29626_4057.N1						IS2	V/V	63	29626	13	4.05
ASA_IMM_1PNPDE20071030_183945_000001402063_00013_29626_7747.N1						IS2	V/V	63	29626	13	4.04
ASA_IMM_1PNPDE20071030_183945_000001402063_00013_29626_7900.N1						IS2	V/V	63	29626	13	4.04
ASA_IMM_1PNPDE20071030_184308_000000742063_00013_29626_7749.N1						IS1	V/V	63	29626	13	4.04
ASA_IMM_1PNPDE20071030_184308_000000742063_00013_29626_7902.N1						IS1	V/V	63	29626	13	4.04
ASA_IMM_1PNPDK20071030_195957_000001122063_00014_29627_4160.N1						IS2	V/V	63	29627	14	4.05
ASA_IMM_1PNPDK20071030_200547_000000372063_00014_29627_4146.N1						IS1	V/V	63	29627	14	4.05
ASA_IMM_1PNPDK20071030_200628_000001612063_00014_29627_4168.N1						IS2	V/V	63	29627	14	4.05
ASA_IMM_1PNPDE20071030_201830_000001362063_00014_29627_8045.N1						IS2	V/V	63	29627	14	4.04
ASA_IMM_1PNPDE20071030_201830_000001362063_00014_29627_8063.N1						IS2	V/V	63	29627	14	4.04
ASA_IMM_1PNPDE20071030_220311_000000542063_00015_29628_8049.N1						IS2	V/V	63	29628	15	4.04
ASA_IMM_1PNPDE20071030_220311_000000542063_00015_29628_8065.N1						IS2	V/V	63	29628	15	4.04

Filename	Pol	Timestamp	count(Module)
ASA_MS__0PNPDK20071030_173332_000000162063_00012_29625_0403.N1	H	2007-10-30 17:33:32	320







ASA_WSM_1PNPDE20071030_223527_000002812063_00015_29628_8242.N1	SS1	H/H	63	29628	15	4.04
ASA_WSM_1PNPDE20071030_223527_000002812063_00015_29628_8275.N1	SS1	H/H	63	29628	15	4.04
ASA_WSM_1PNPDE20071030_224027_000001832063_00015_29628_8225.N1	SS1	H/H	63	29628	15	4.04
ASA_WSM_1PNPDE20071030_224027_000001832063_00015_29628_8233.N1	SS1	H/H	63	29628	15	4.04
ASA_WSM_1PNPDE20071030_224849_000002392063_00015_29628_8235.N1	SS1	H/H	63	29628	15	4.04
ASA_WSM_1PNPDE20071030_224849_000002392063_00015_29628_8266.N1	SS1	H/H	63	29628	15	4.04
ASA_WSM_1PNPDK20071030_232631_000002812063_00016_29629_4215.N1	SS1	H/H	63	29629	16	4.05










ASA_WVS_1PNPDE20071030_202053_000019492063_00014_29627_7671.N1	IS2	V/V	63	29627	14	4.04
ASA_WVS_1PNPDE20071030_211050_000001952063_00014_29627_7510.N1	IS2	V/V	63	29627	14	4.04
ASA_WVS_1PNPDE20071030_211050_000001952063_00014_29627_7662.N1	IS2	V/V	63	29627	14	4.04
ASA_WVS_1PNPDE20071030_211305_000001052063_00014_29627_7879.N1	IS2	V/V	63	29627	14	4.04
ASA_WVS_1PNPDE20071030_211305_000001052063_00014_29627_7967.N1	IS2	V/V	63	29627	14	4.04
ASA_WVS_1PNPDE20071030_220016_000001352063_00015_29628_7772.N1	IS2	V/V	63	29628	15	4.04
ASA_WVS_1PNPDE20071030_220411_000018292063_00015_29628_7884.N1	IS2	V/V	63	29628	15	4.04
ASA_WVS_1PNPDE20071030_220411_000018292063_00015_29628_7972.N1	IS2	V/V	63	29628	15	4.04
ASA_WVS_1PNPDE20071030_225244_000001952063_00015_29628_7887.N1	IS2	V/V	63	29628	15	4.04
ASA_WVS_1PNPDE20071030_225244_000001952063_00015_29628_7975.N1	IS2	V/V	63	29628	15	4.04
ASA_WVS_1PNPDE20071030_225459_000008992063_00015_29628_8104.N1	IS2	V/V	63	29628	15	4.04
ASA_WVS_1PNPDE20071030_231431_000006742063_00016_29629_8107.N1	IS2	V/V	63	29629	16	4.04
ASA_WVS_1PNPDE20071030_234439_000009892063_00016_29629_8129.N1	IS2	V/V	63	29629	16	4.04



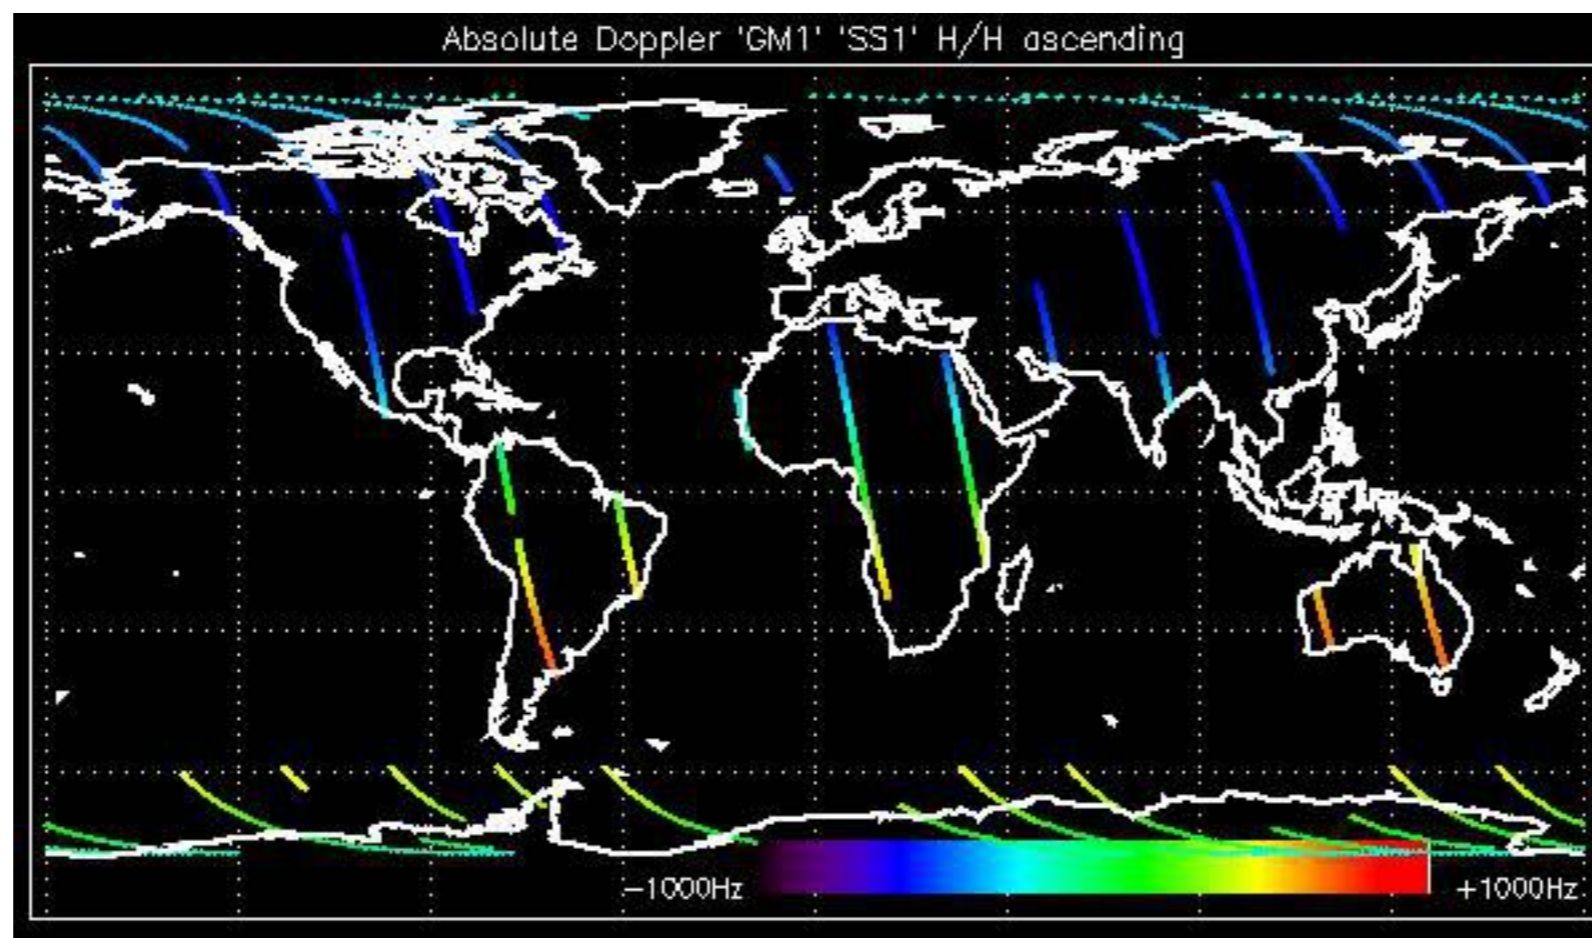


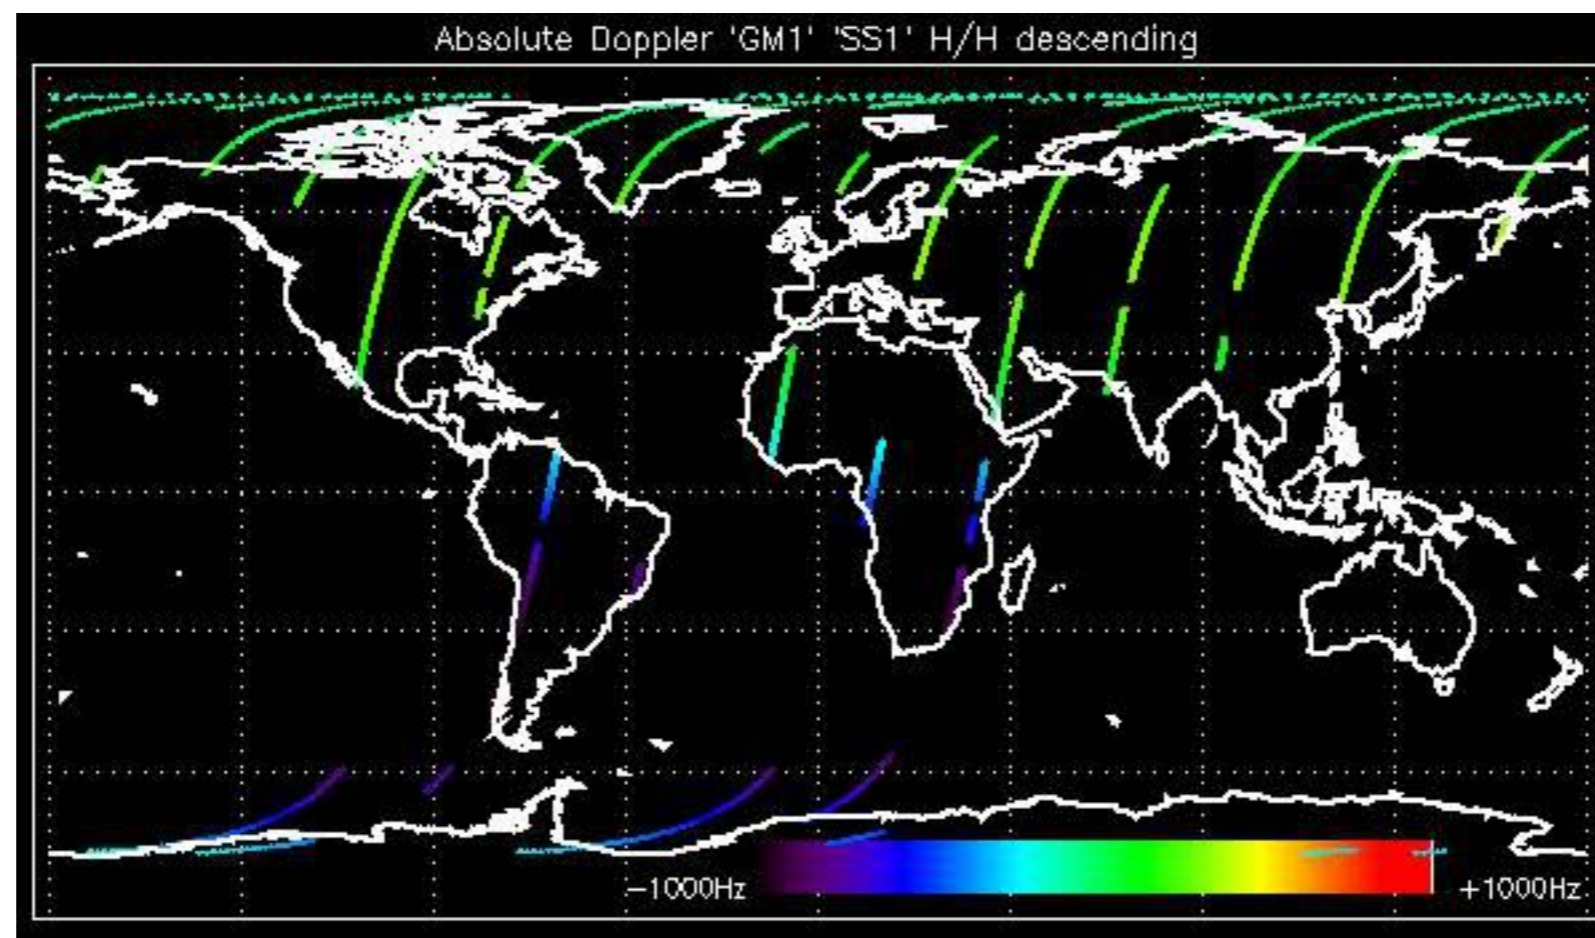

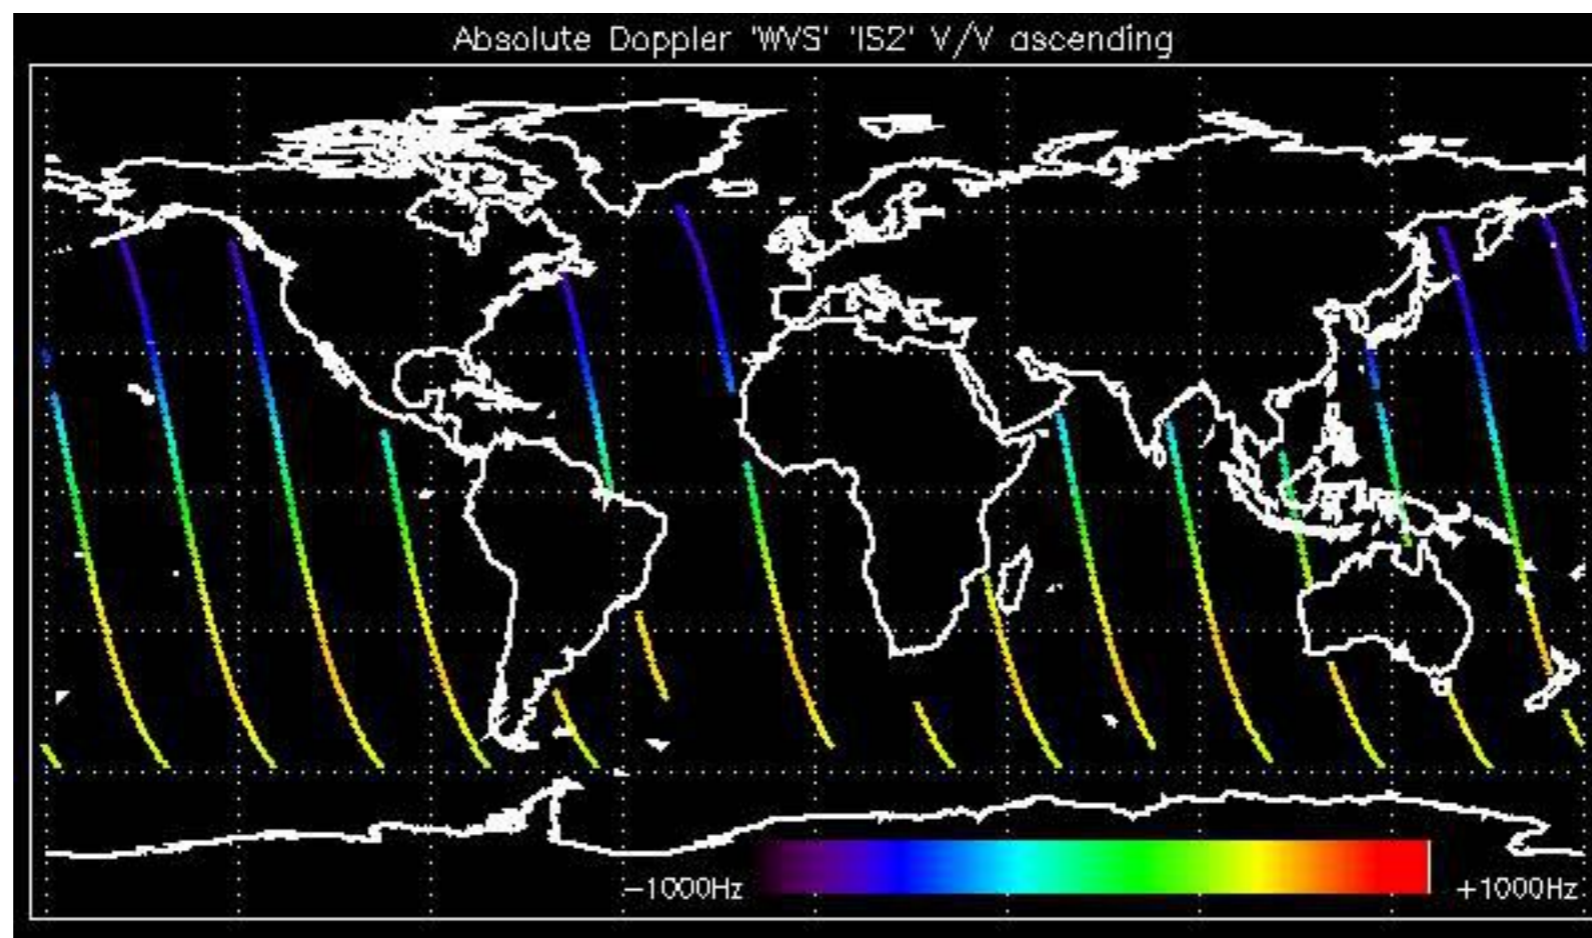


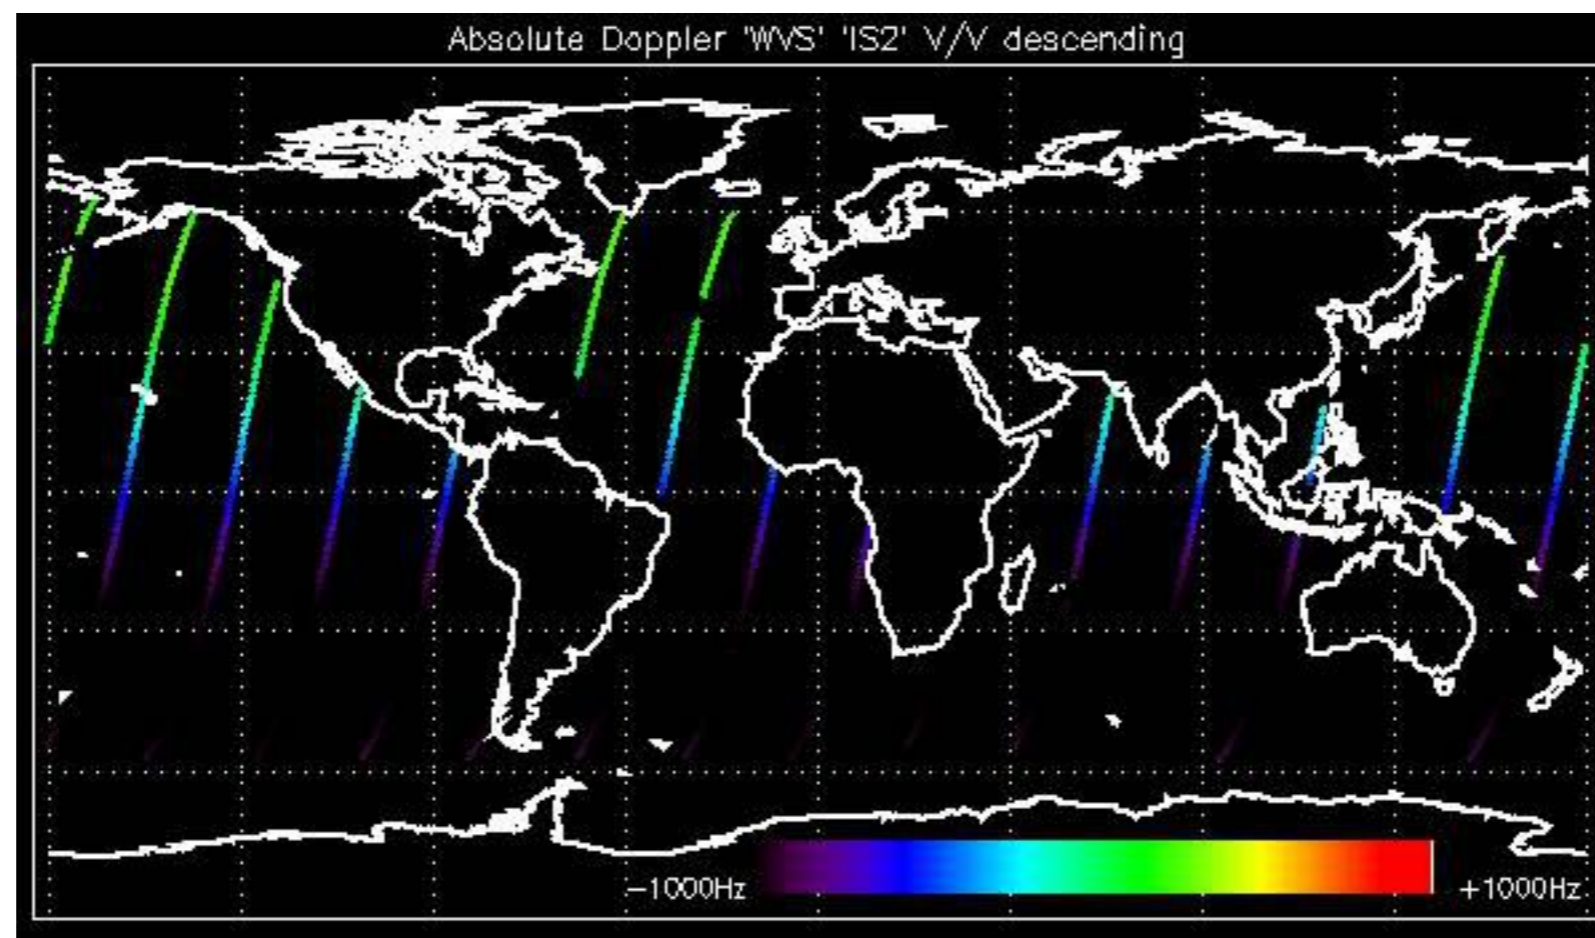


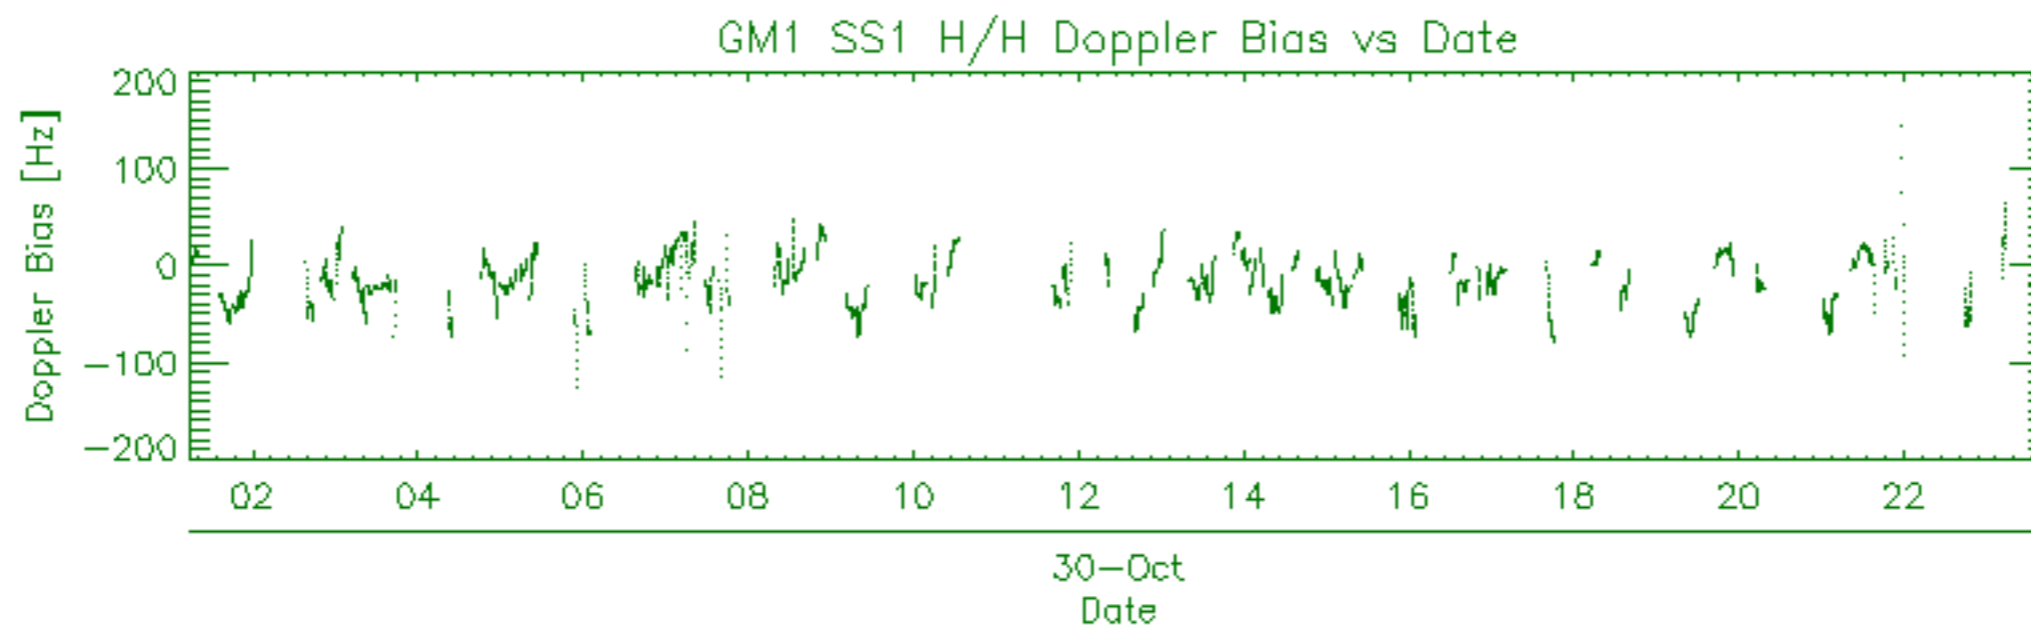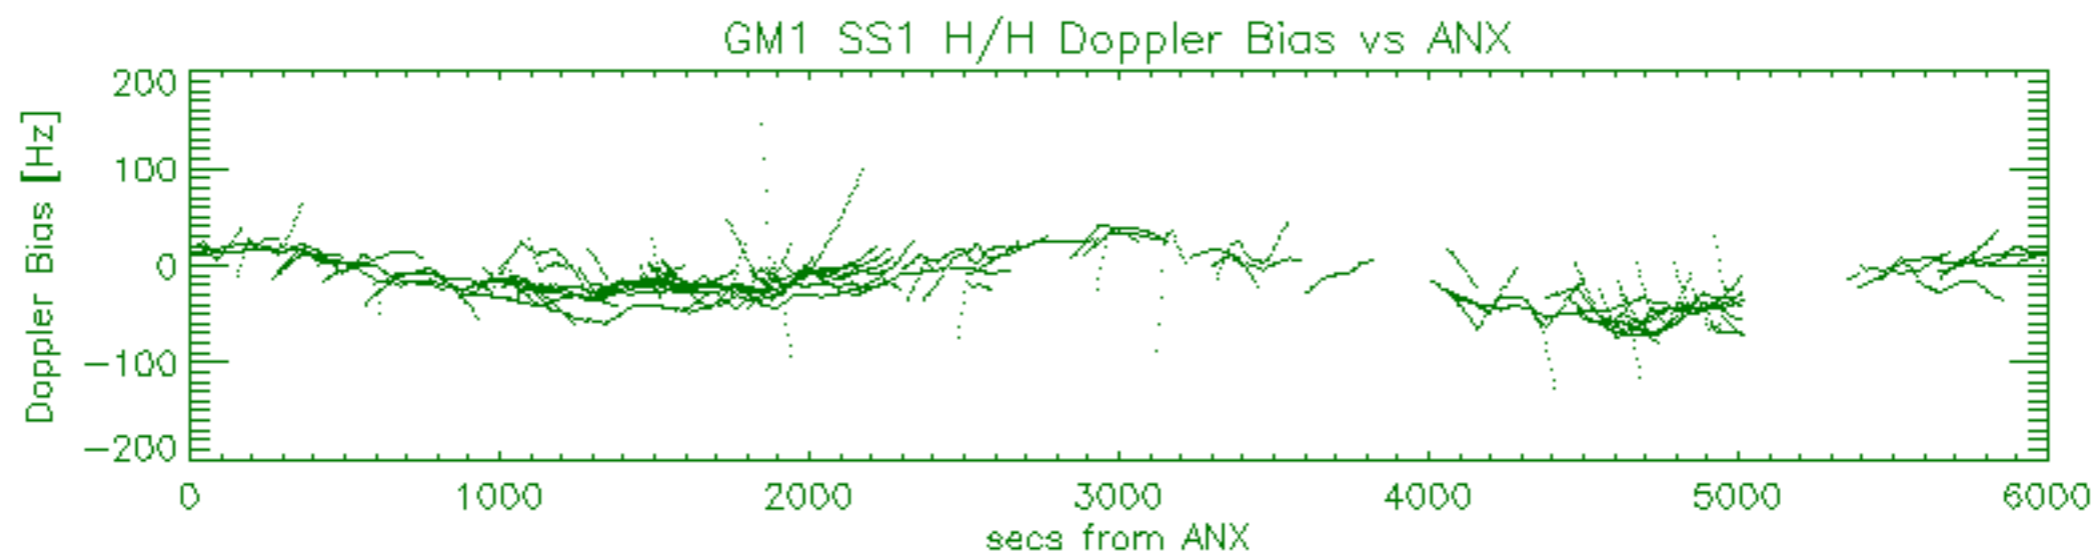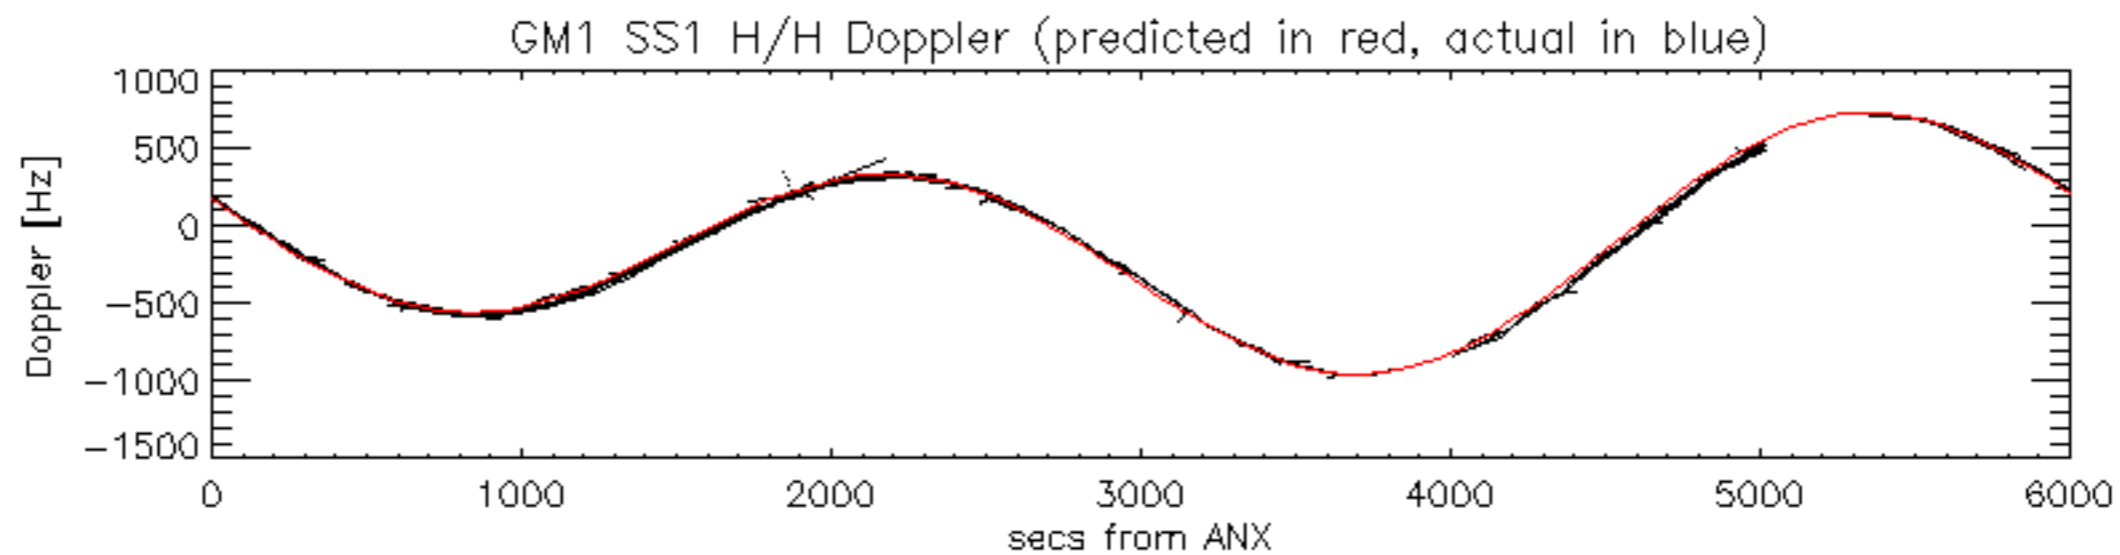


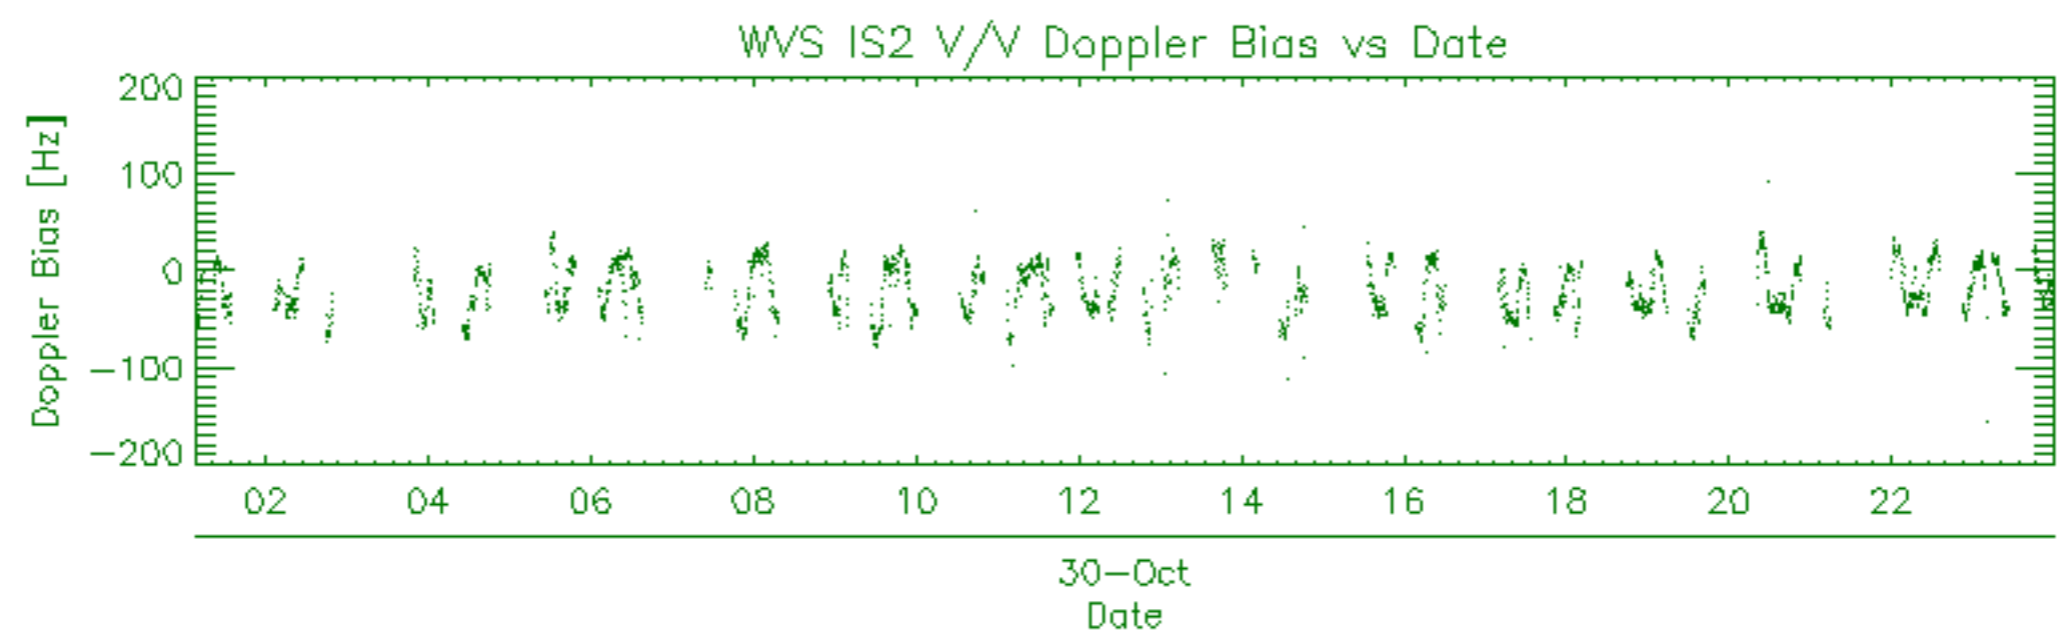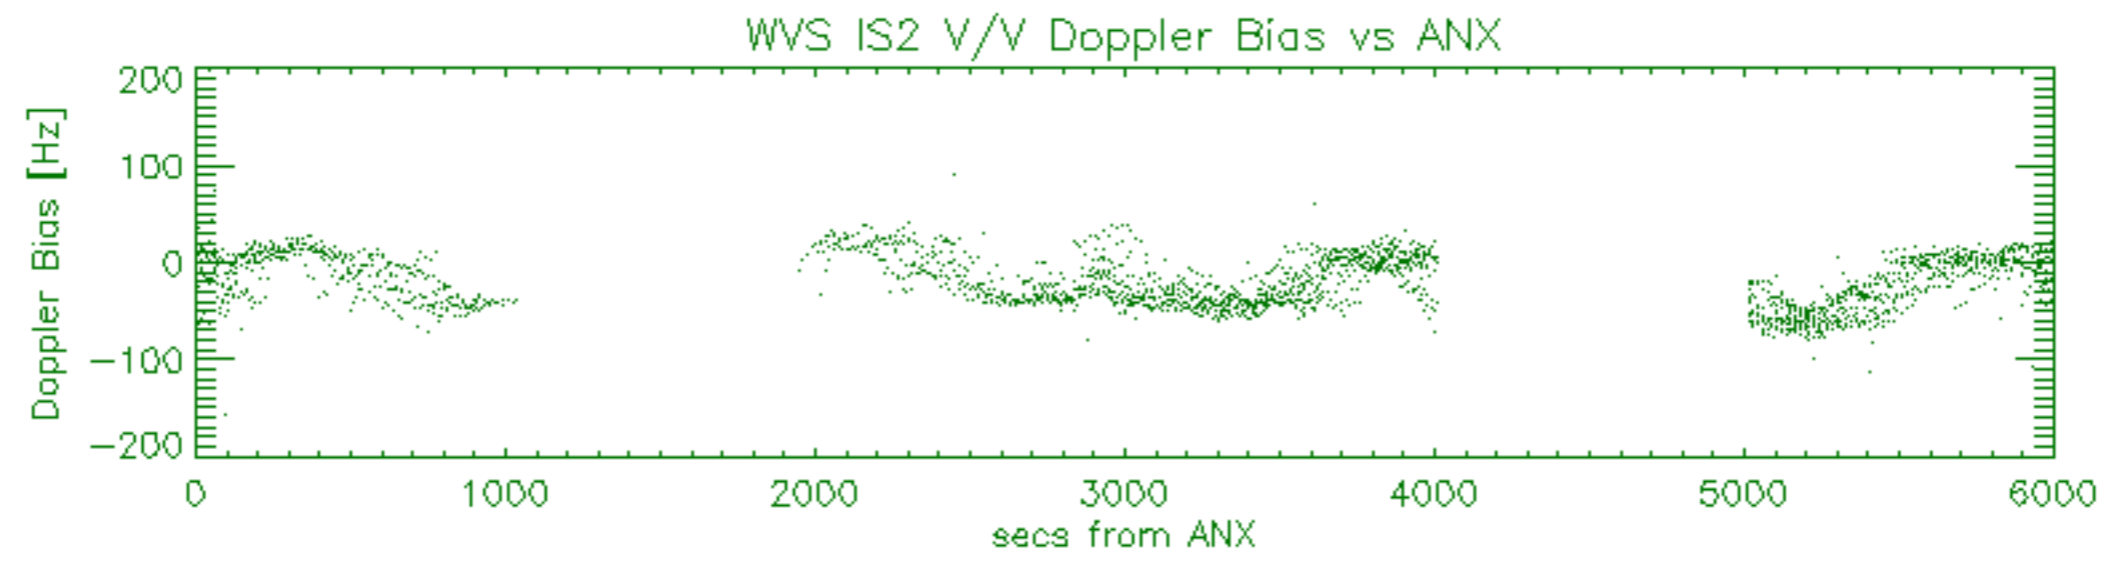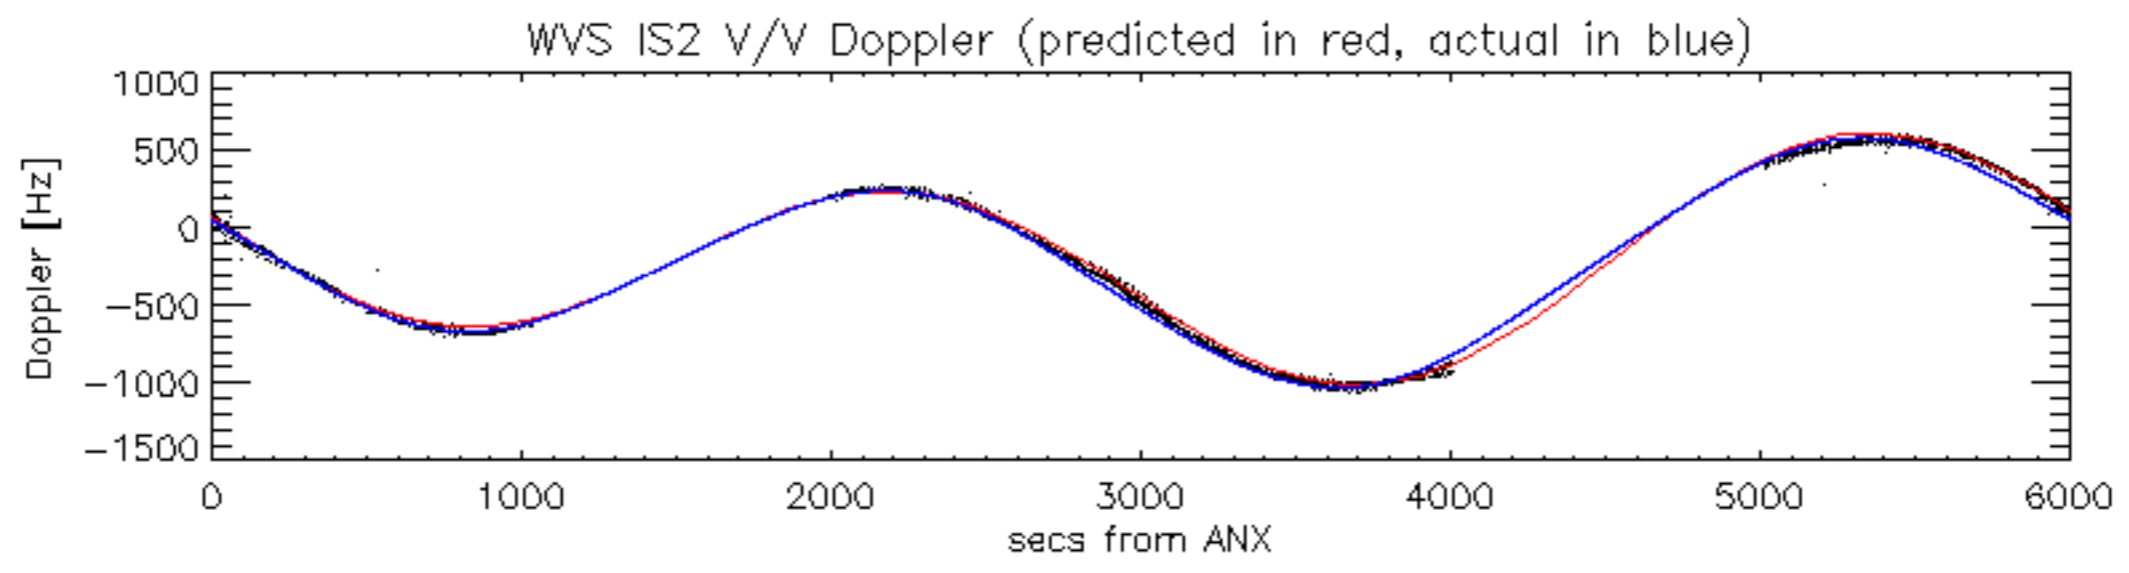








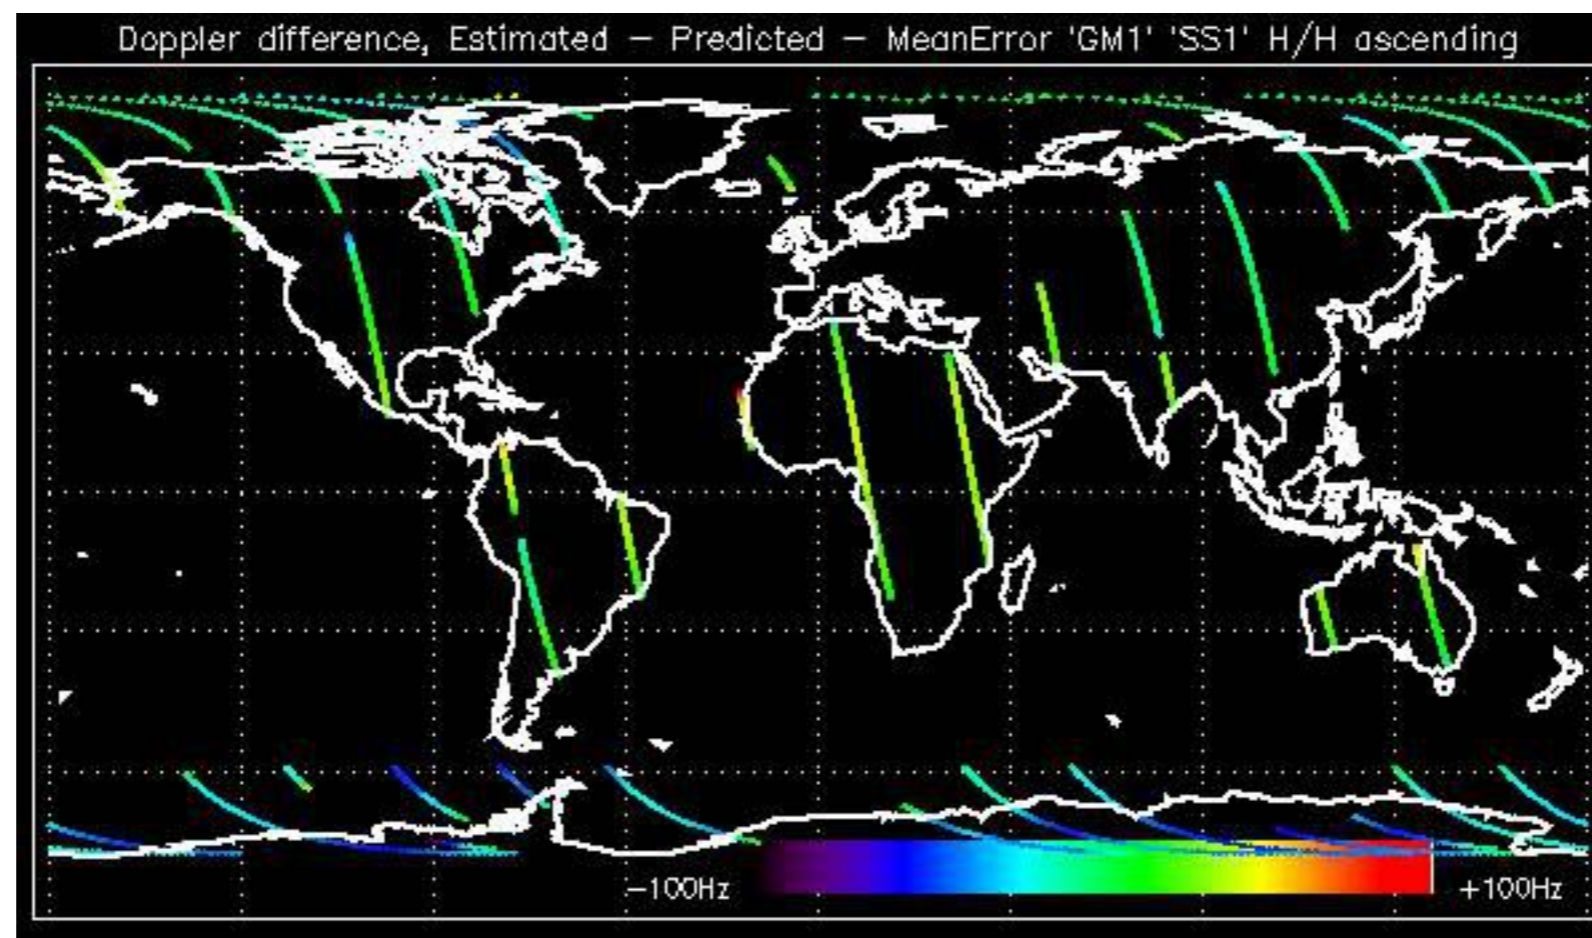


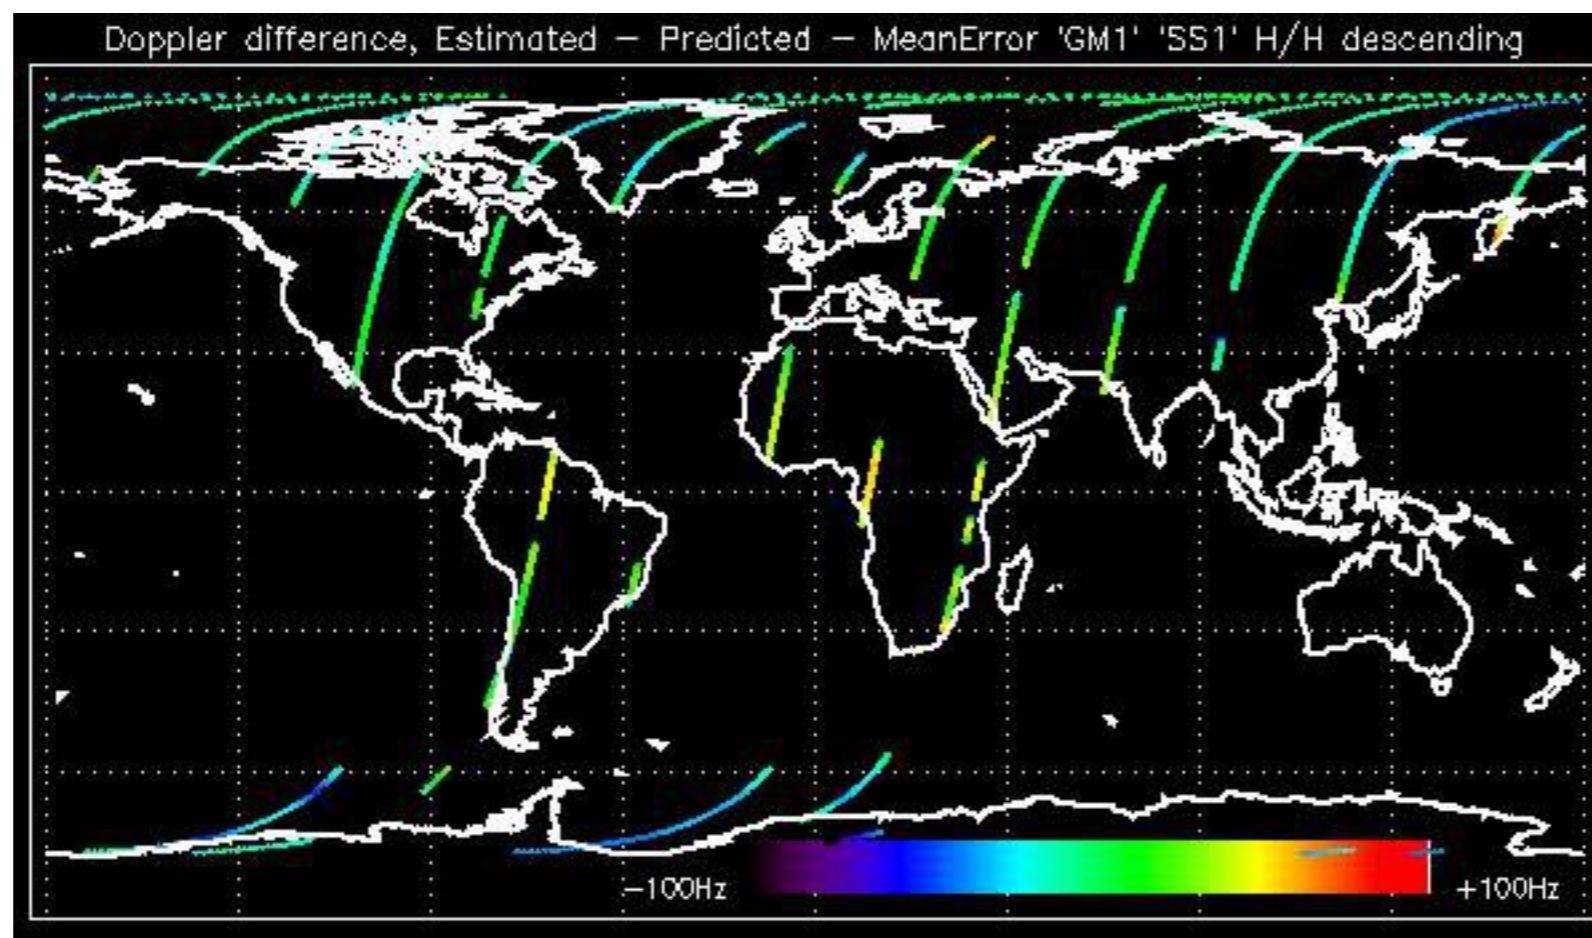

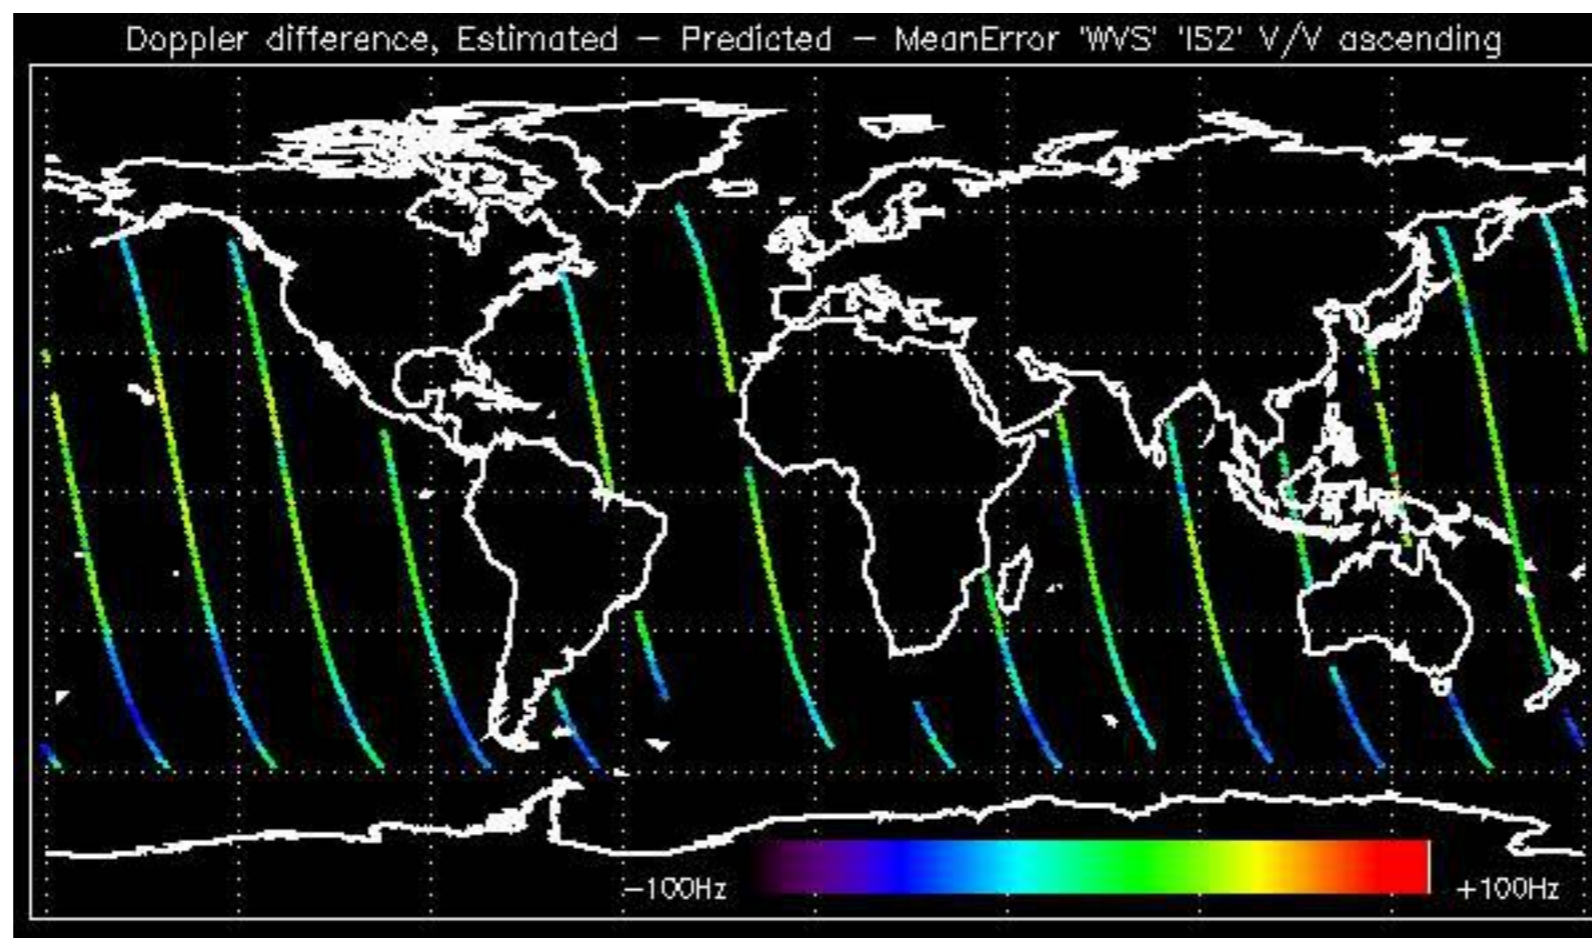

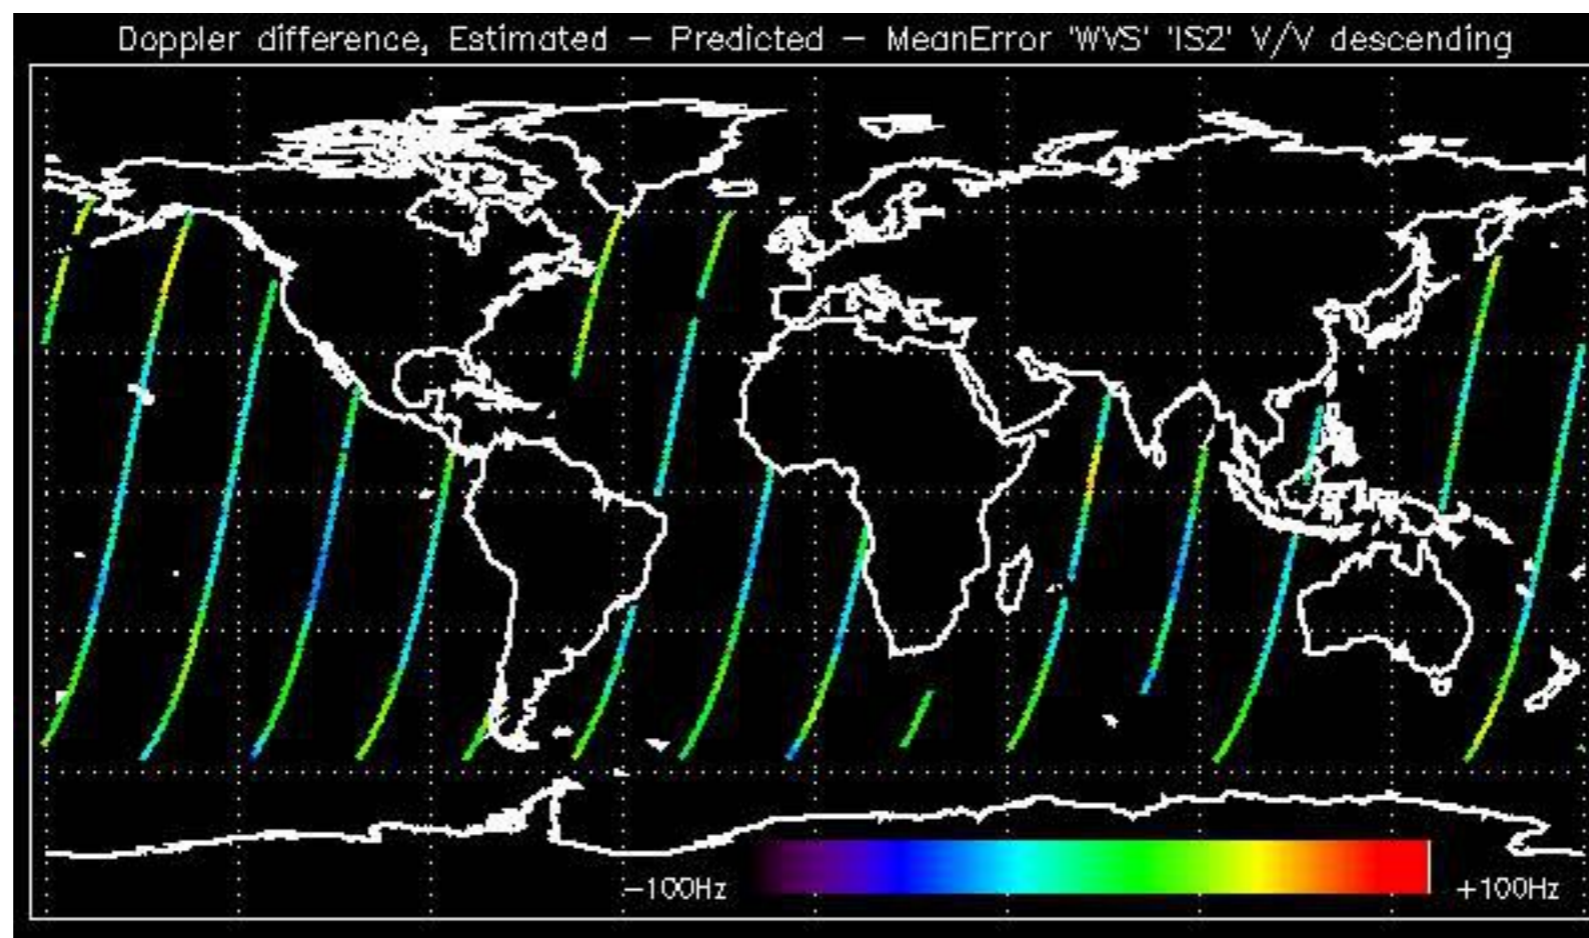

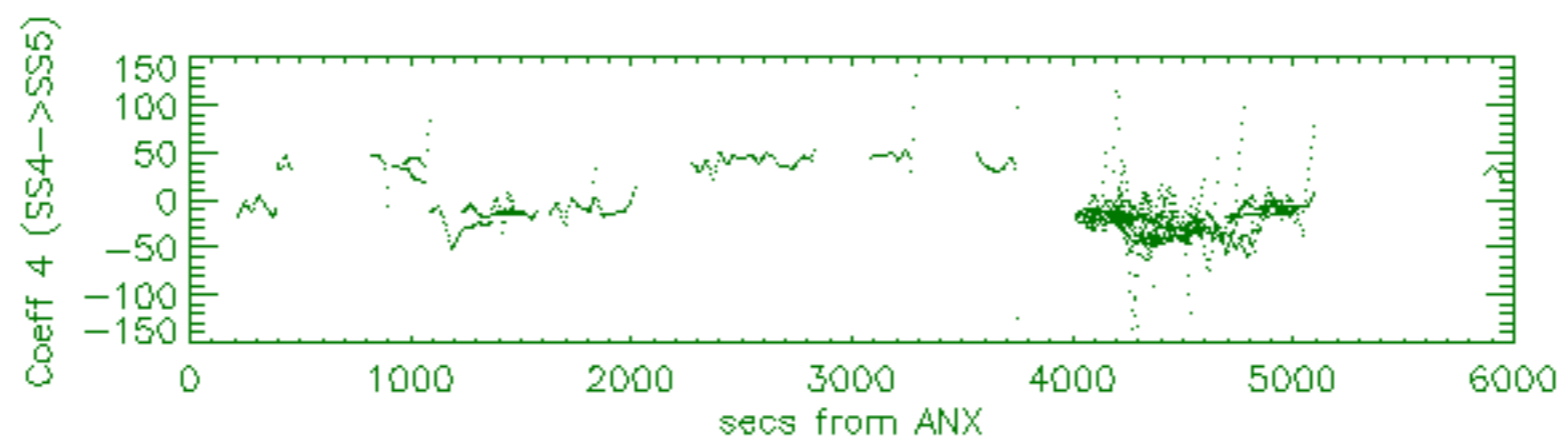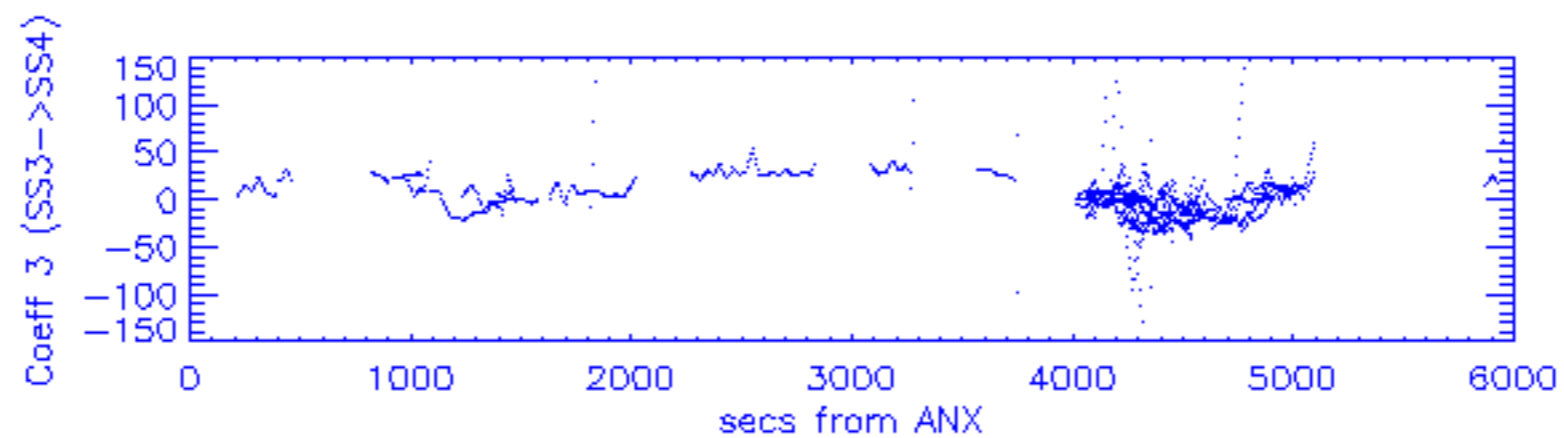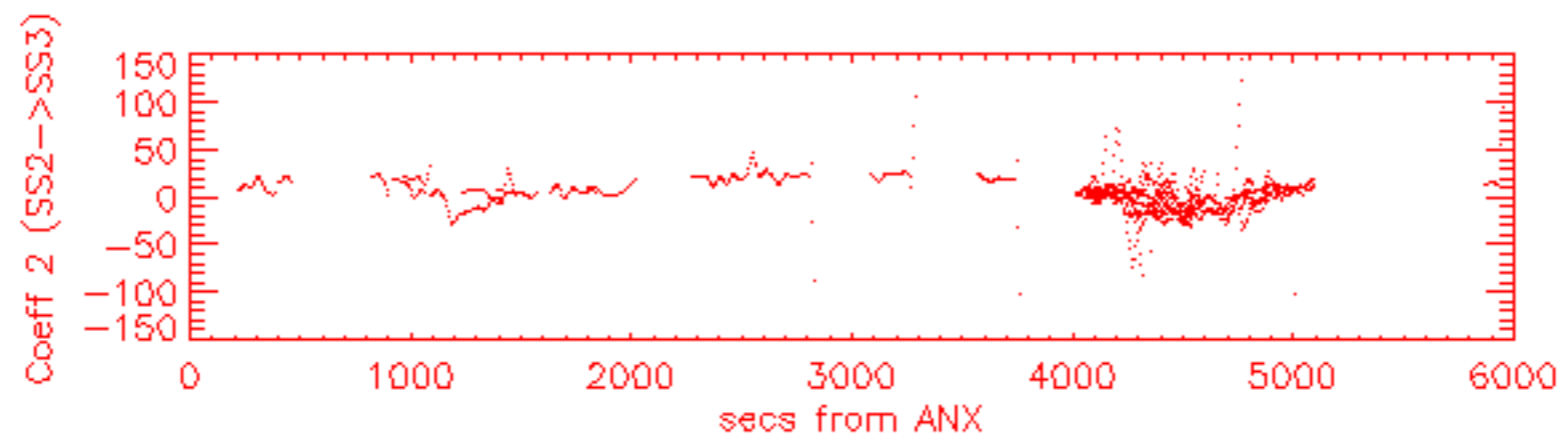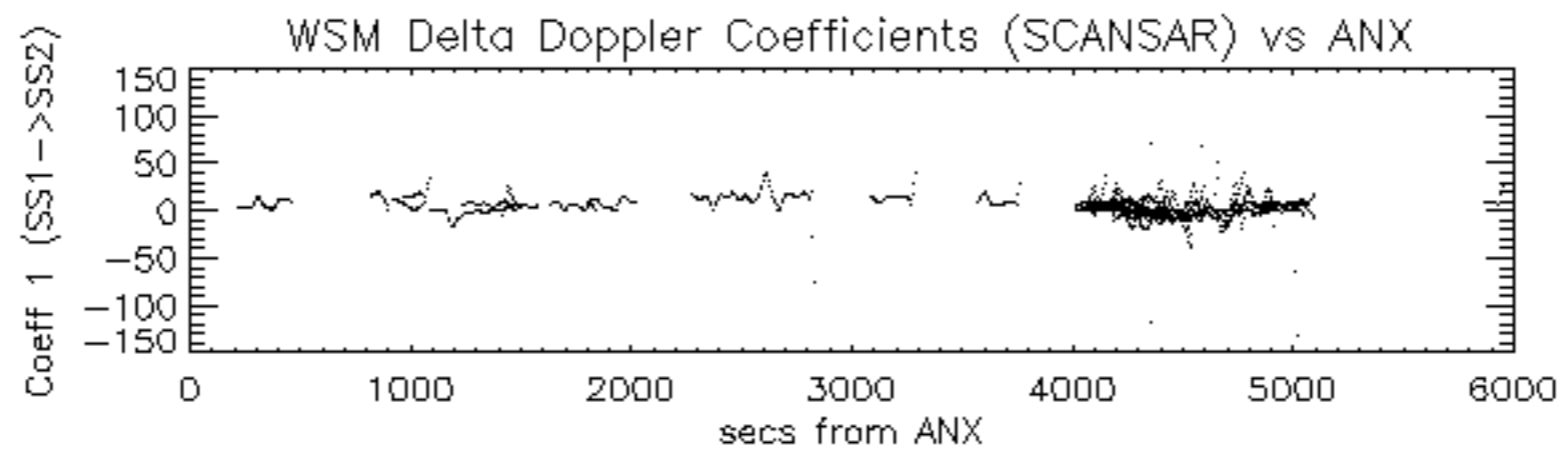

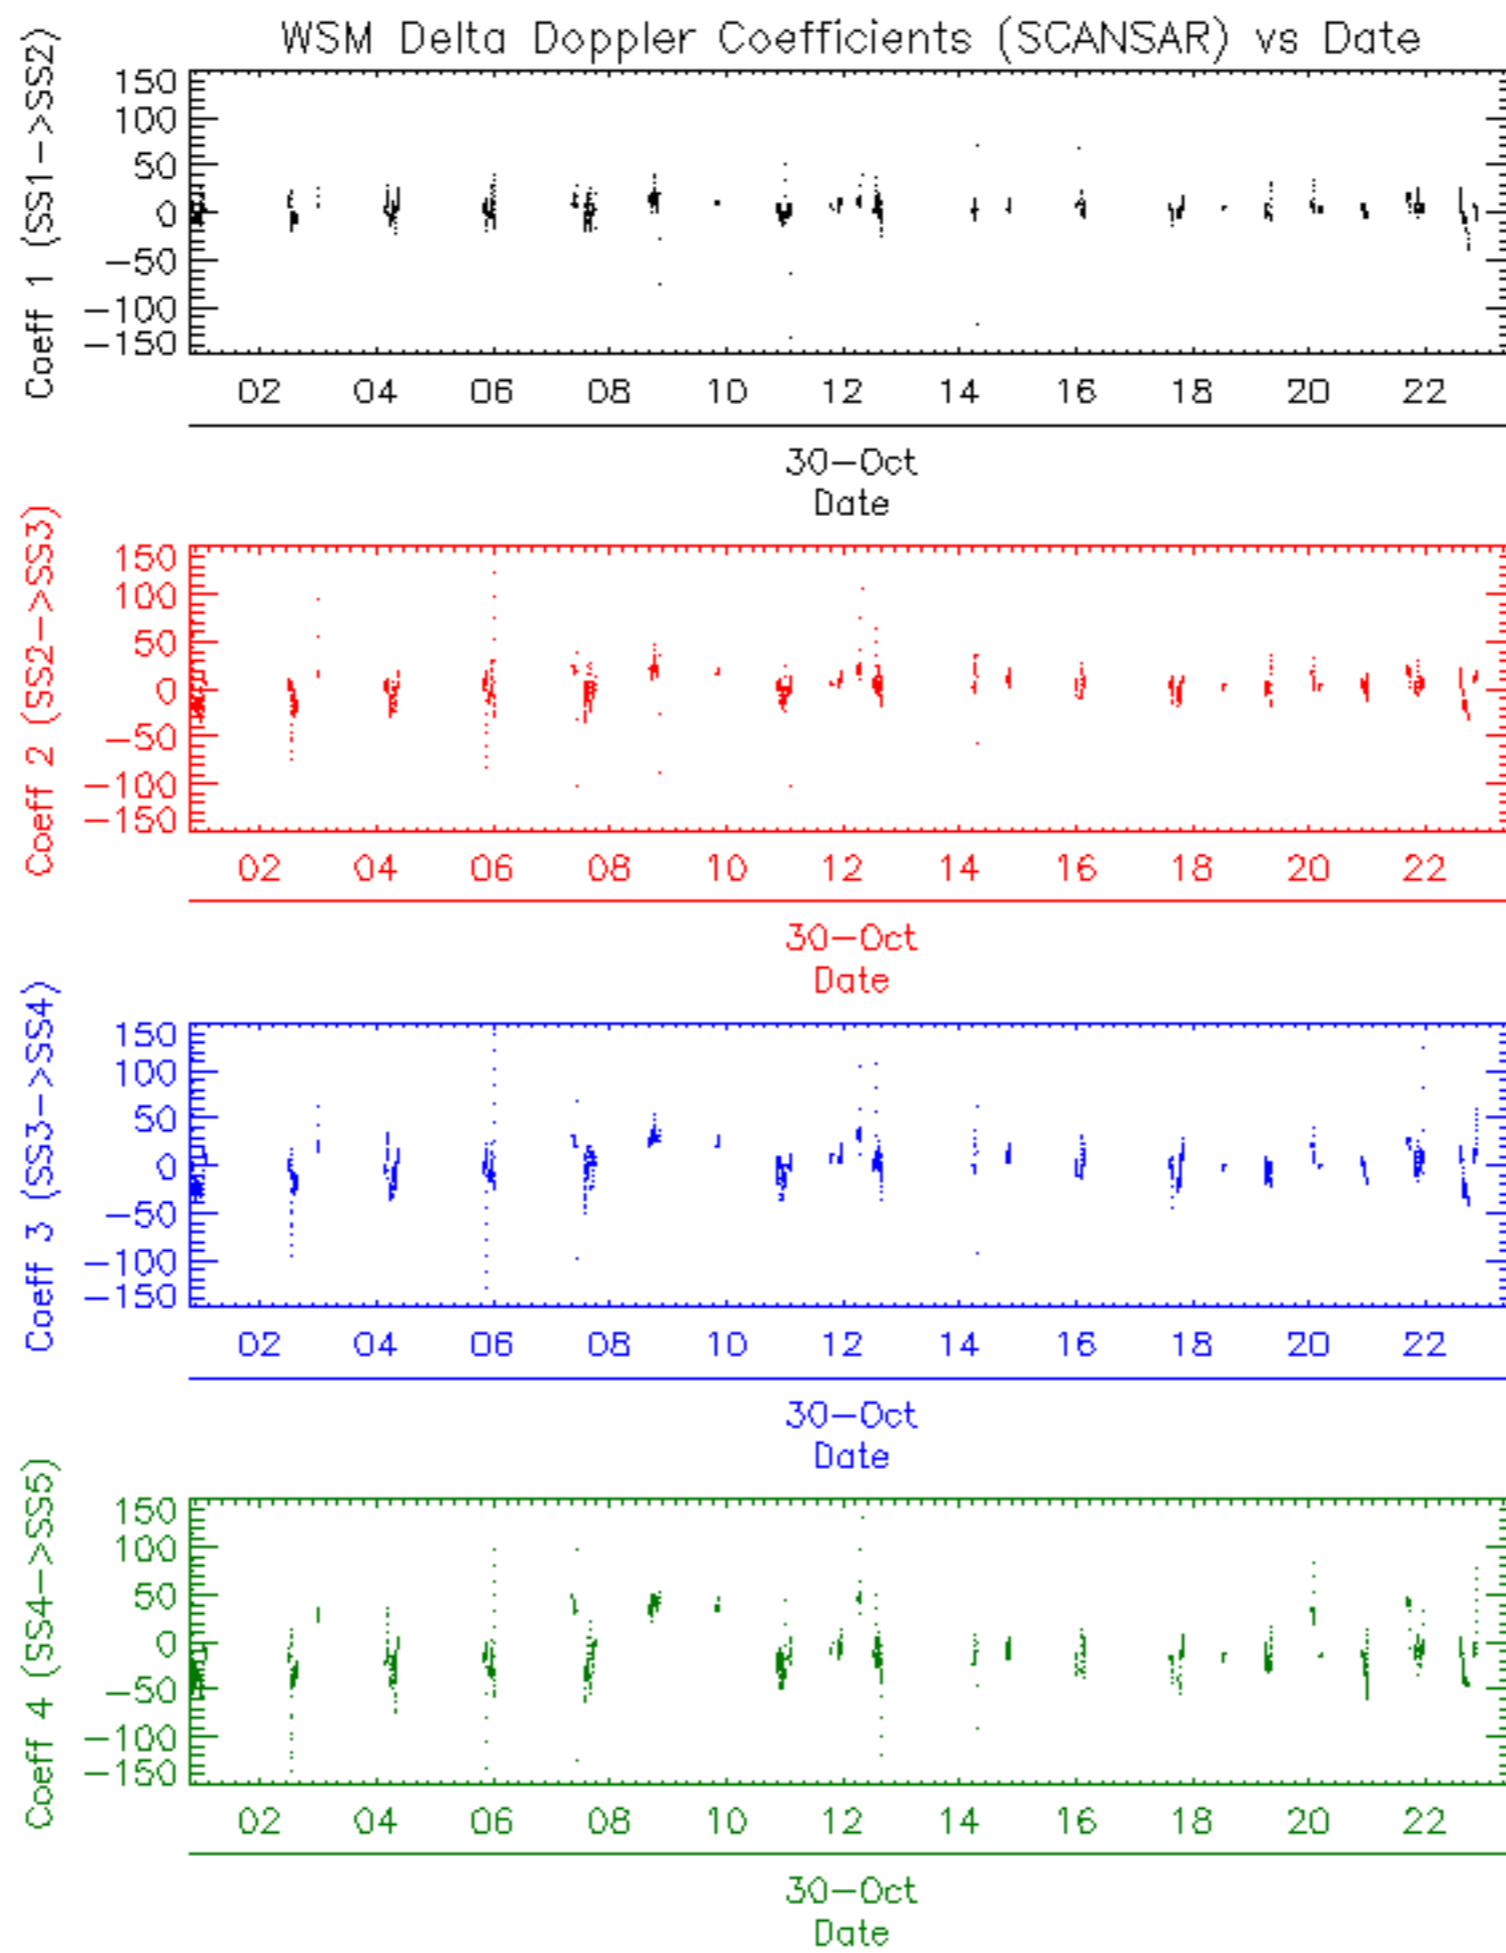






















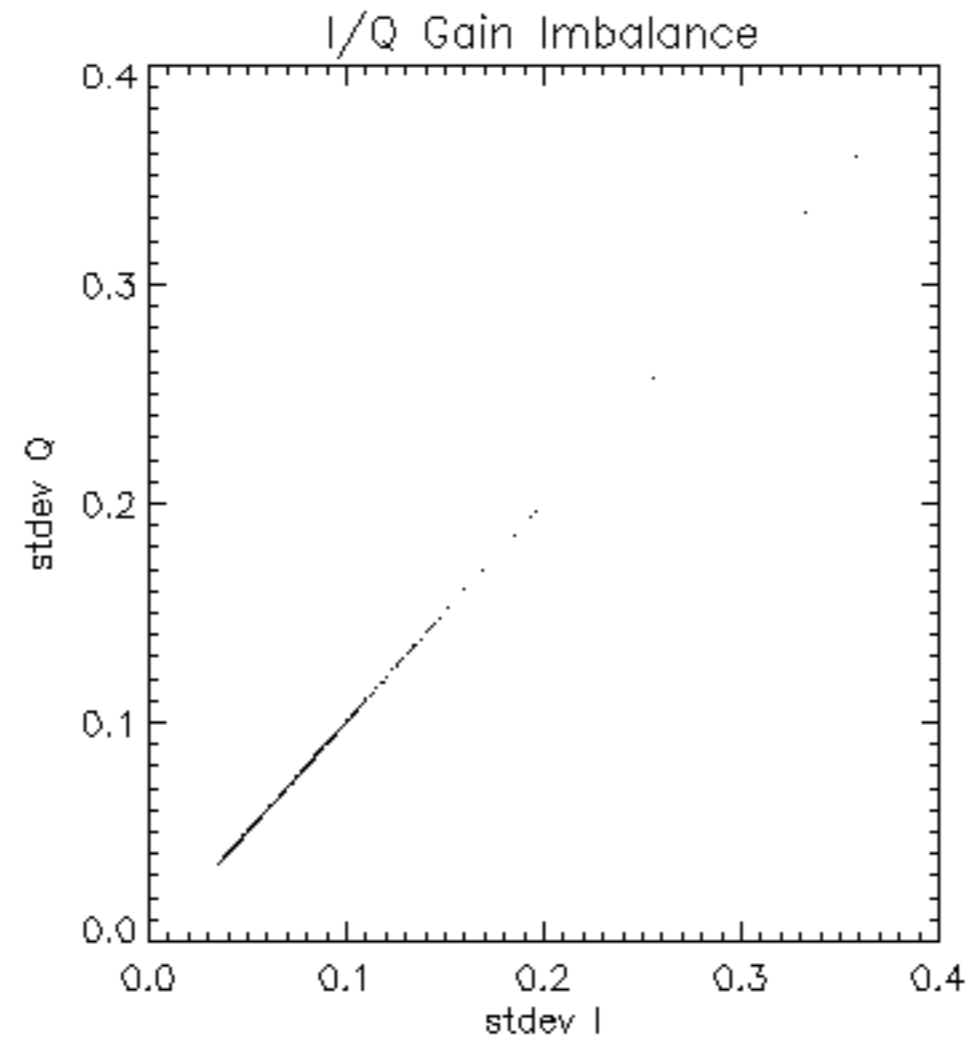


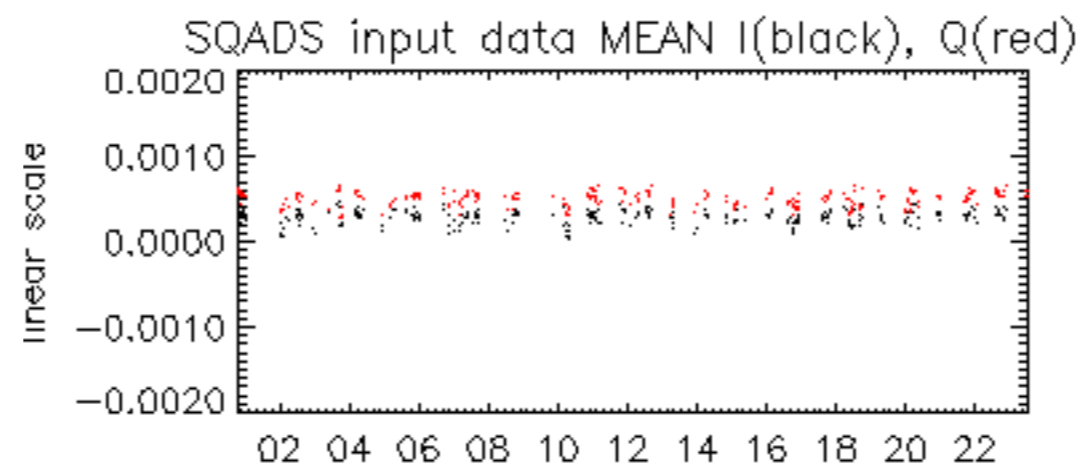

30-Oct



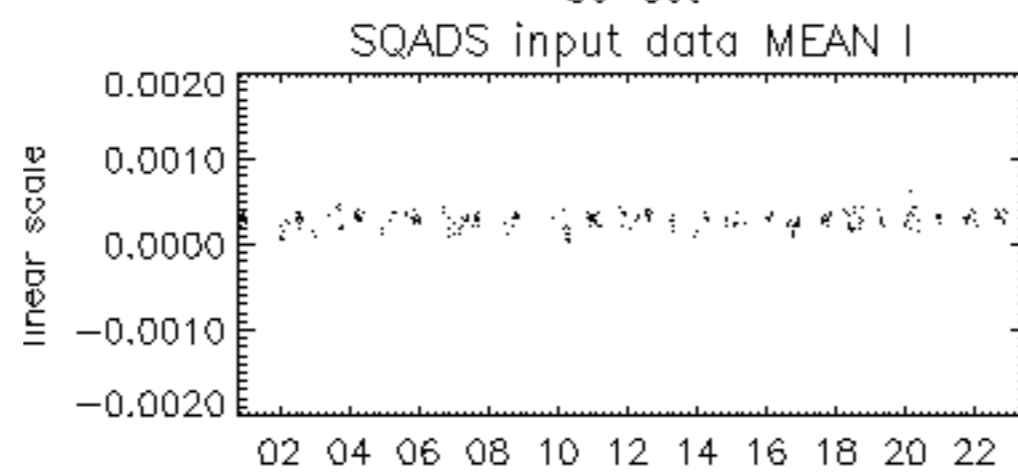



30-Oct

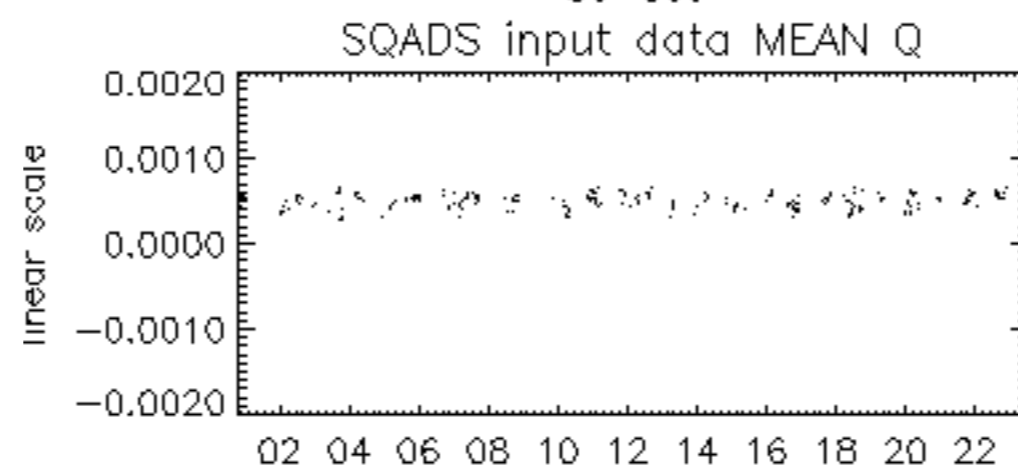


30-Oct




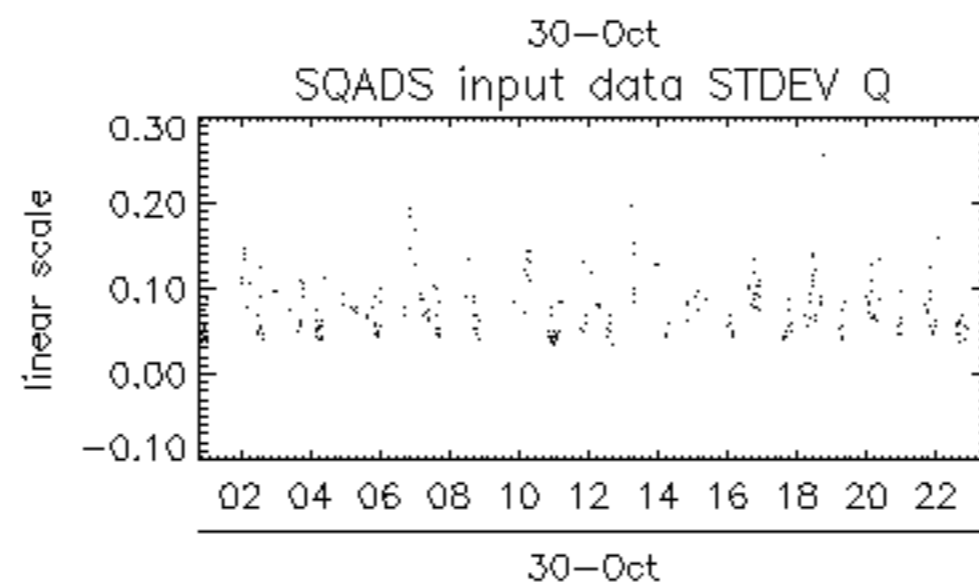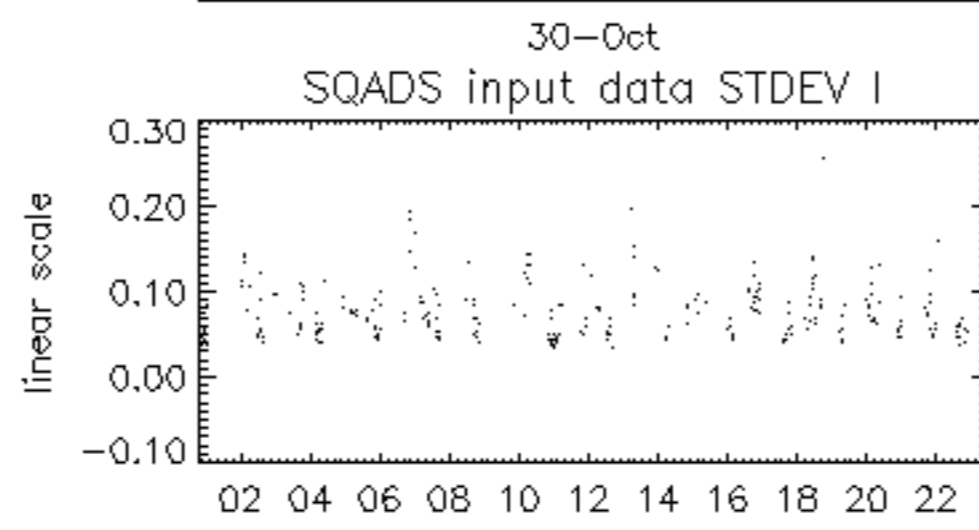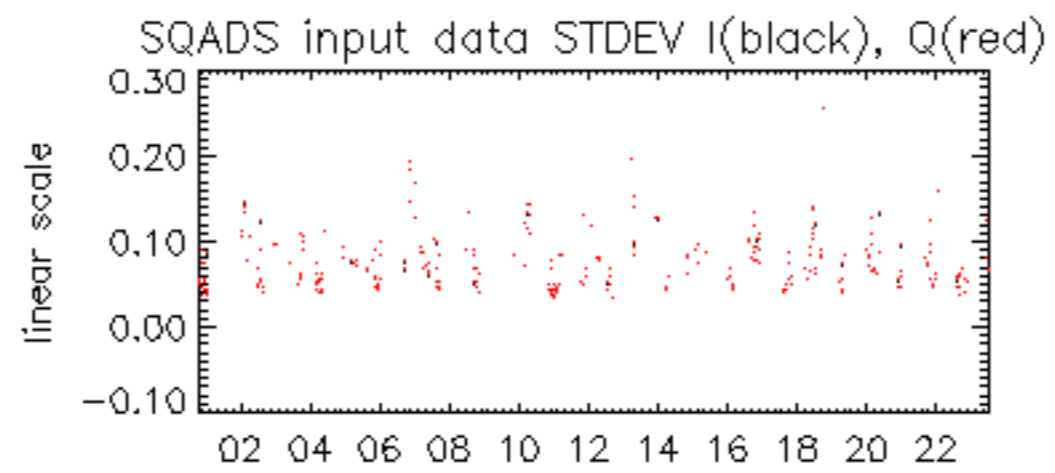

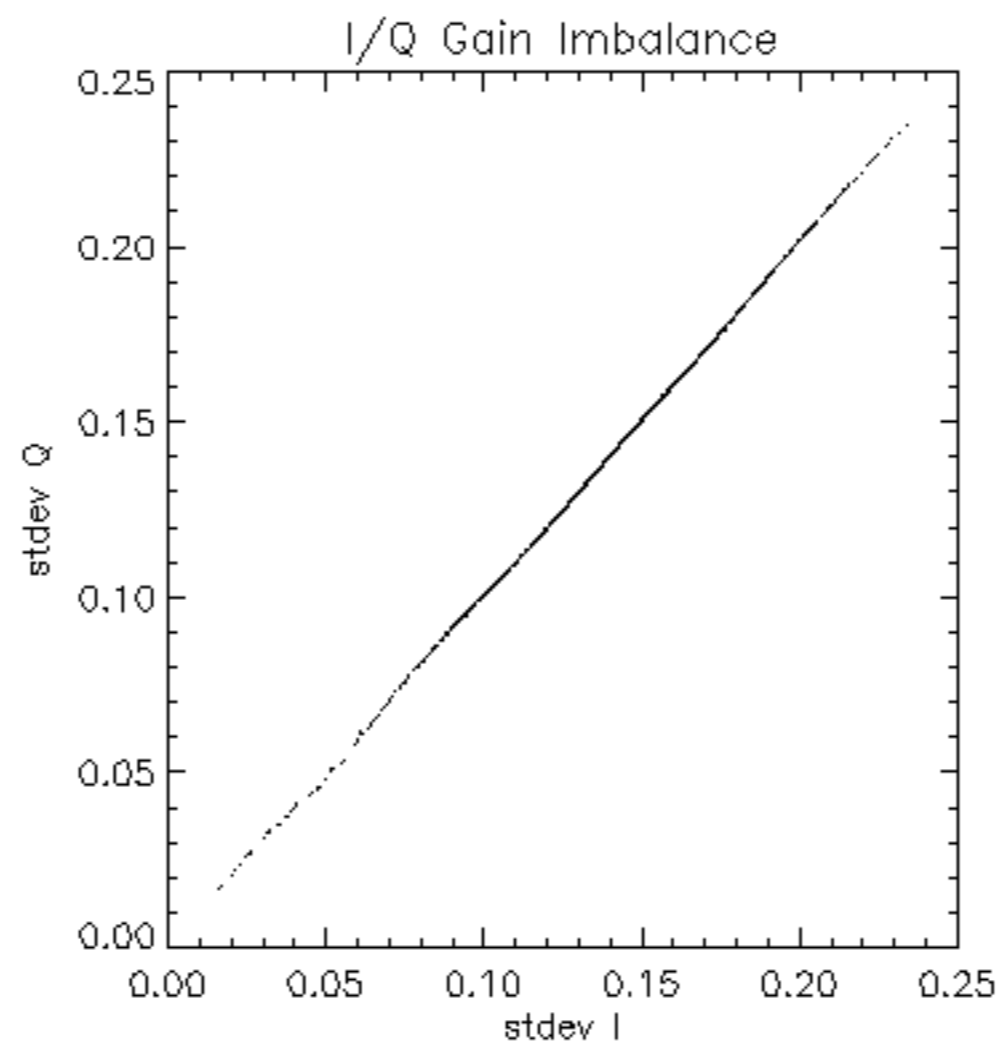


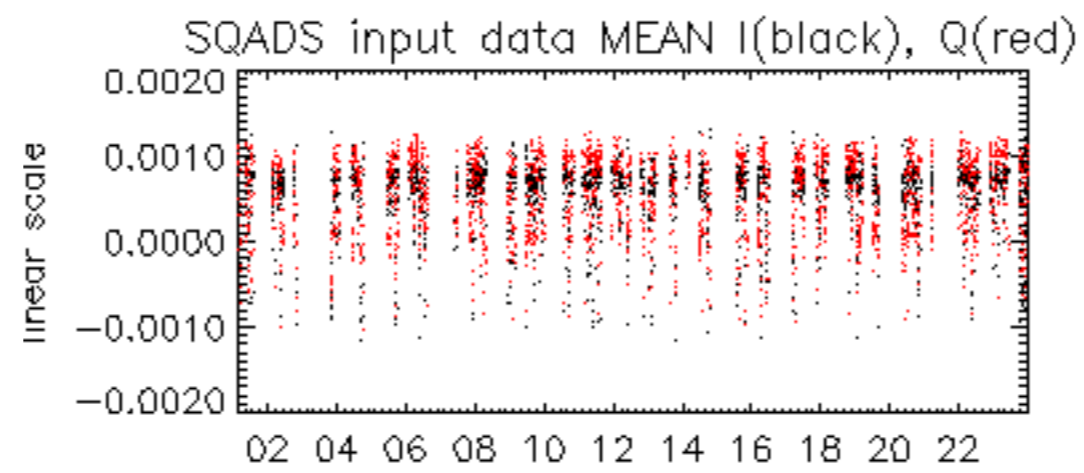


30-Oct

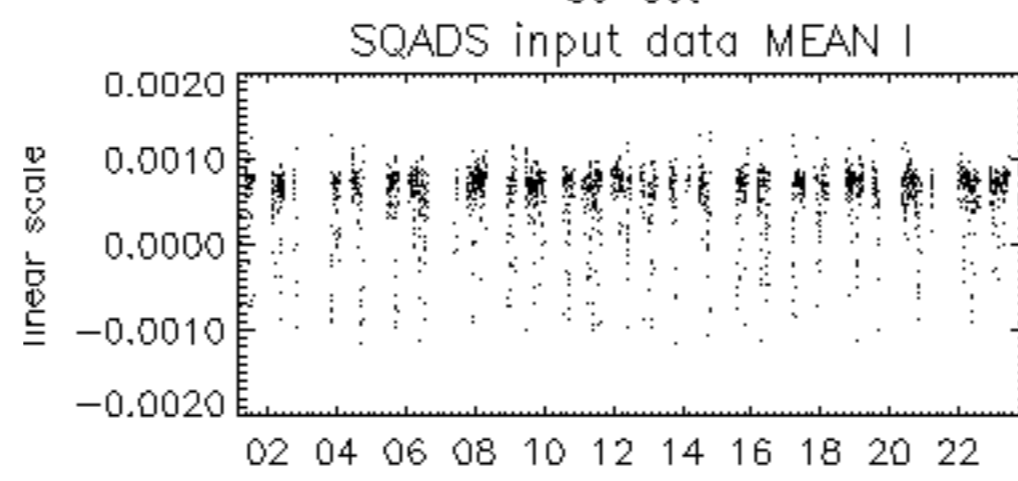


30-Oct

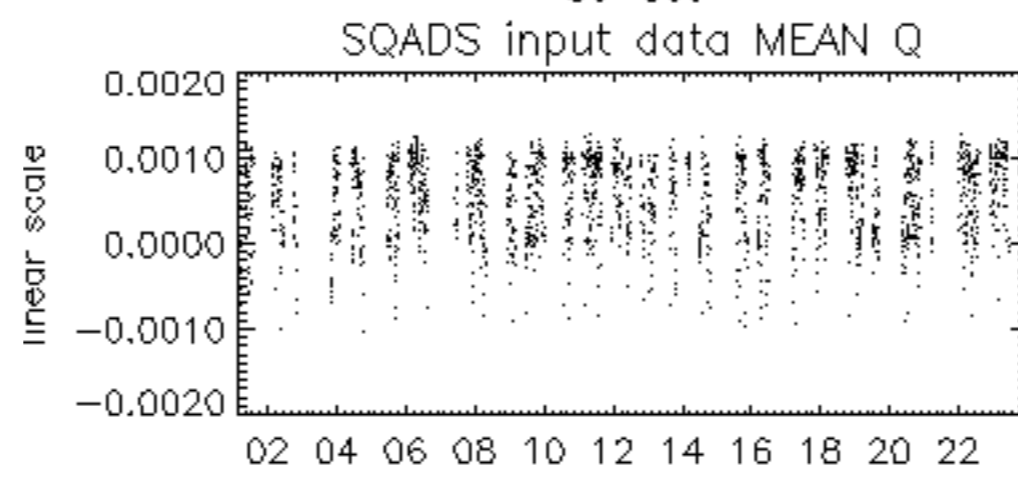


30-Oct

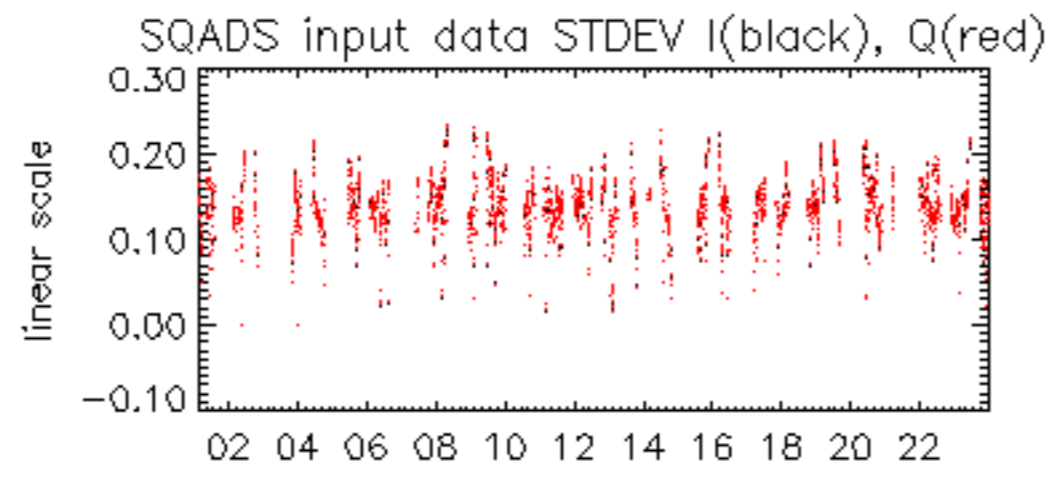

30-Oct

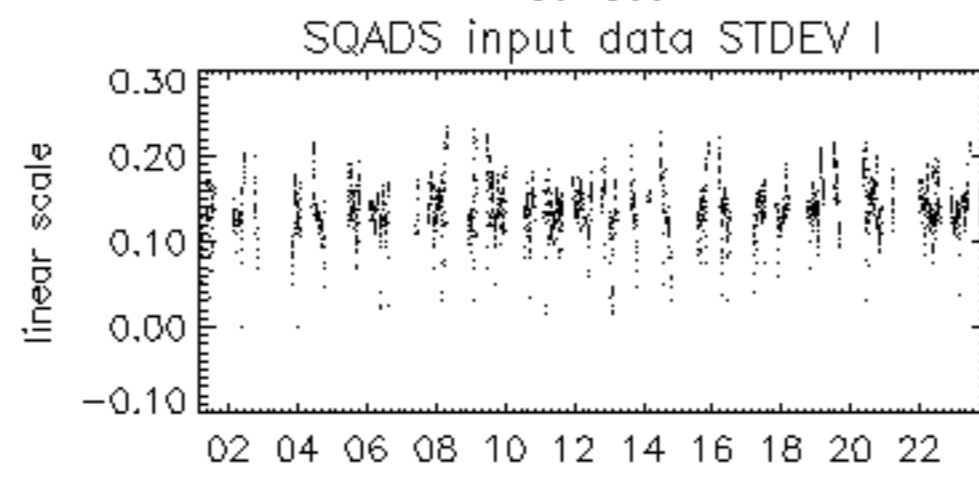

30-Oct

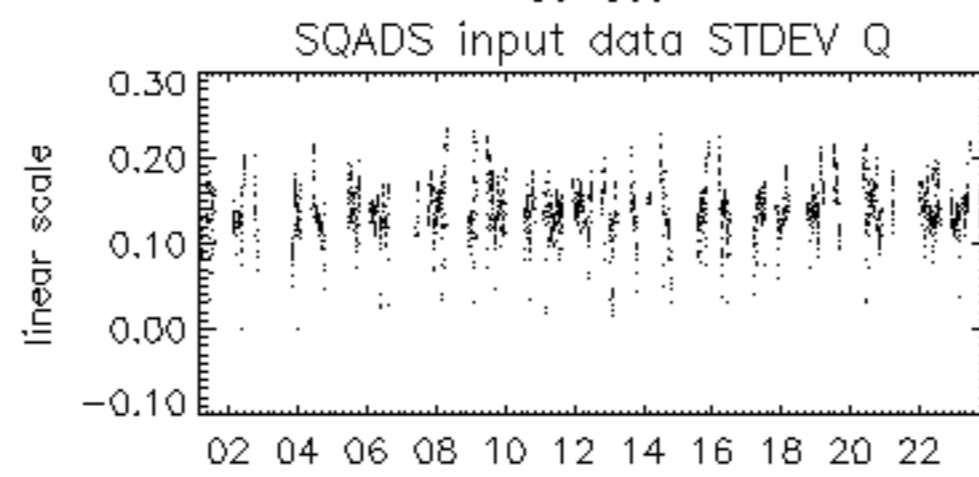

30-Oct





















