



ASAR Daily Report



Analysis from 04-JAN-2008 00:00:00 to 04-JAN-2008 23:59:59. Page generated on 05-JAN-2008 08:51:54.
View log file: ASAR_Daily_Report_20080105_0730.log. For any anomalies please contact mtranfaglia@serco.it, gscarpino@serco.it.

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

SUMMARY

1. DATA SUMMARY
 - 1.1 Summary tables
 - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
 - 2.1 IECF operational ADFs list
 - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
 - 3.1 V/V polarisation
 - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
 - 4.1 Analysis for WVS IS2 V/V
 - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
 - 4.1.2 All Rows Analysis for WVS IS2 V/V
 - 4.2 Analysis for GM1 SS3 H/H
 - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
 - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
 - 5.1 Analysis for WVS IS2 V/V
 - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
 - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
 - 5.2 Analysis for GM1 SS1 H/H
 - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
 - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
 - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
 - 6.1 Analysis for WSM SS1 H/H
 - 6.1.1 ScaleFactor
 - 6.2 Analysis for WSM SS1 V/V
 - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
 - 7.1 Analysis for WVS
 - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
 - 8.1 Number of Missing Lines
 - 8.2 Number of Gaps

1 - DATA SUMMARY

1.1 - Summary tables

[[BACK TO MENU](#)]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS2	V/V	24	PDE	WS	H/H	33	PDE	IS2	H/H	2	PDE	IS1	V/V	1	PDE	WS	H/H	14	PDK	2008-01-04 14:38:11	H	320
PDK	IS2	V/V	28	PDK	WS	H/H	53					PDE	IS2	***	1	PDE	WS	V/V	19				
												PDE	IS2	H/H	36	PDK	WS	H/H	12				
												PDE	IS2	V/V	11	PDK	WS	V/V	2				
												PDE	IS3	H/H	1								
												PDE	IS4	H/H	1								
												PDE	IS4	V/V	2								
												PDE	IS5	V/V	1								
												PDE	IS6	V/V	1								
												PDE	IS7	H/H	1								
												PDE	IS7	V/V	1								
												PDK	IS1	V/V	1								
												PDK	IS2	H/H	3								
												PDK	IS2	V/V	7								
												PDK	IS6	V/V	1								

1.2 - Lists of products used

[[BACK TO MENU](#)]

[[TXT](#)] [[XLS](#)] [List_WVS_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_GM1_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_APM_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_IMM_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_WSM_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_MS_products_used](#)

2 - AUXILIARY FILES ANALYSIS

2.1 - IECF operational ADFs list

[[BACK TO MENU](#)]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20071218_084201_20070204_165113_20081231_000000
ASA_INS_AXVIEC20071218_083603_20070307_060000_20081231_000000
ASA_XCH_AXVIEC20051219_162547_20020301_000000_20081231_000000
ASA_XCA_AXVIEC20071218_082742_20070204_165113_20081231_000000

2.2 - Products with wrong ADFs

[[BACK TO MENU](#)]





Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0

IMM	0	0	0	0
WSM	0	0	0	0

- [TXT] [XLS] Check_ADFs_WVS
- [TXT] [XLS] Check_ADFs_GM1
- [TXT] [XLS] Check_ADFs_APM
- [TXT] [XLS] Check_ADFs_IMM
- [TXT] [XLS] Check_ADFs_WSM

3 - MODULE STEPPING PRODUCTS ANALYSIS





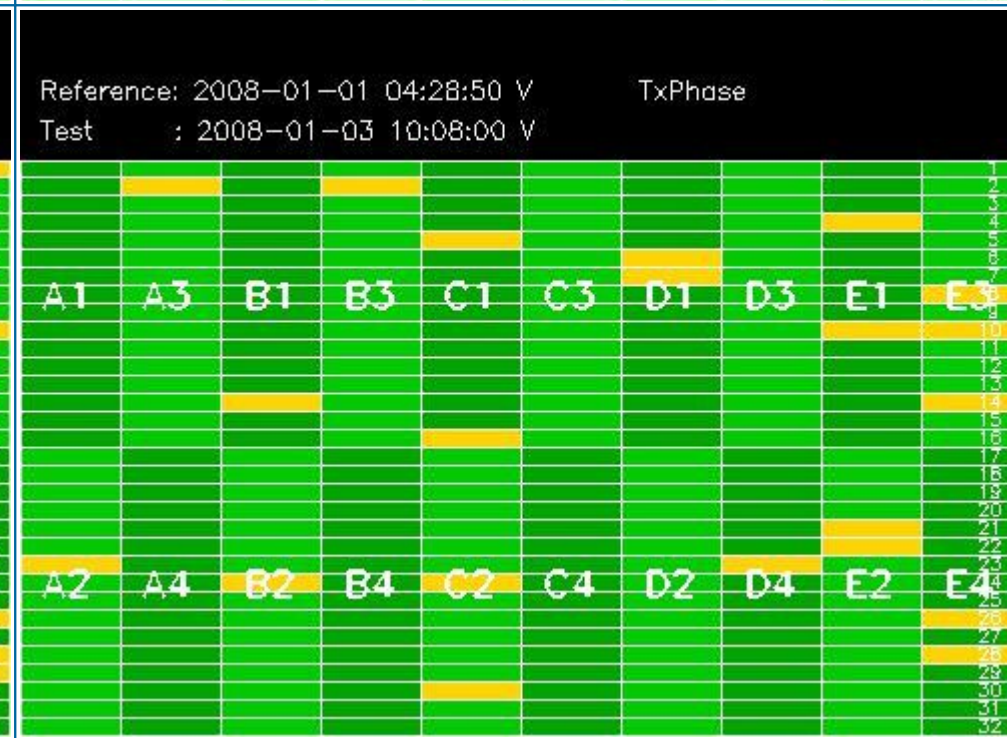
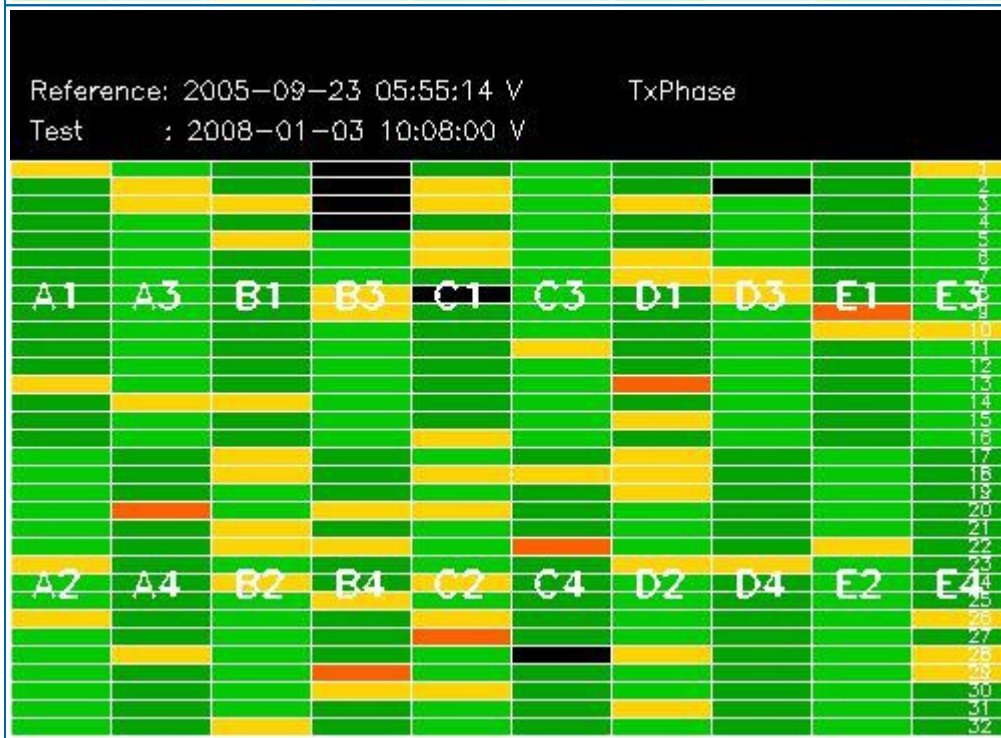
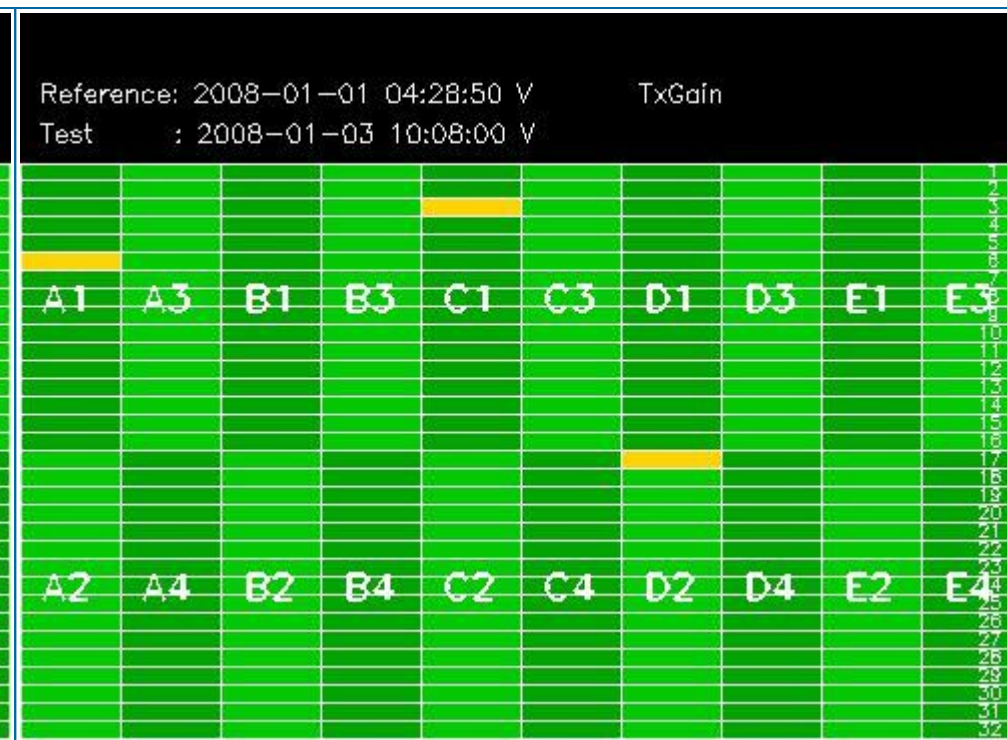
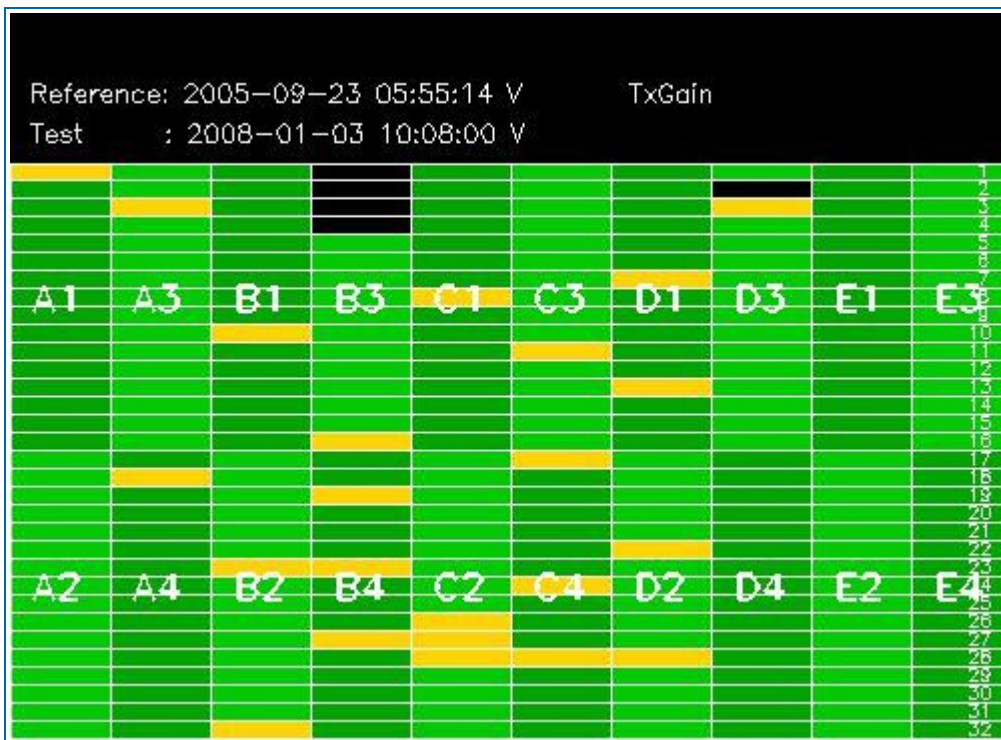


3.2 - H/H polarisation

[[BACK TO MENU](#)]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
After antenna maintenance (2005-09-22/23)	Previous product in the same polarisation

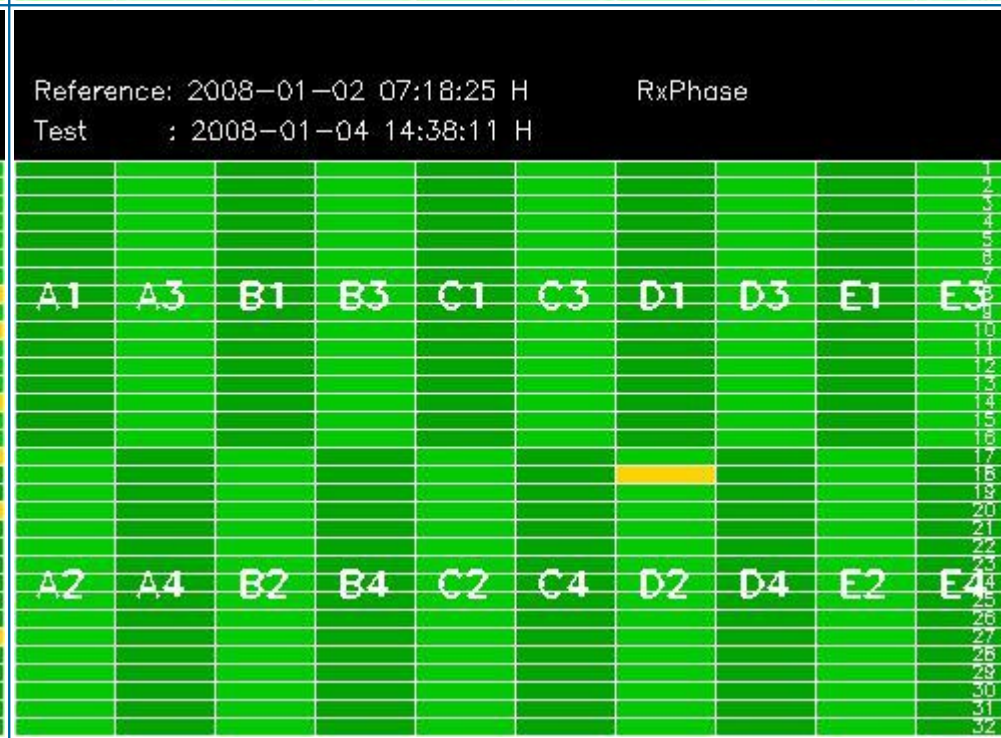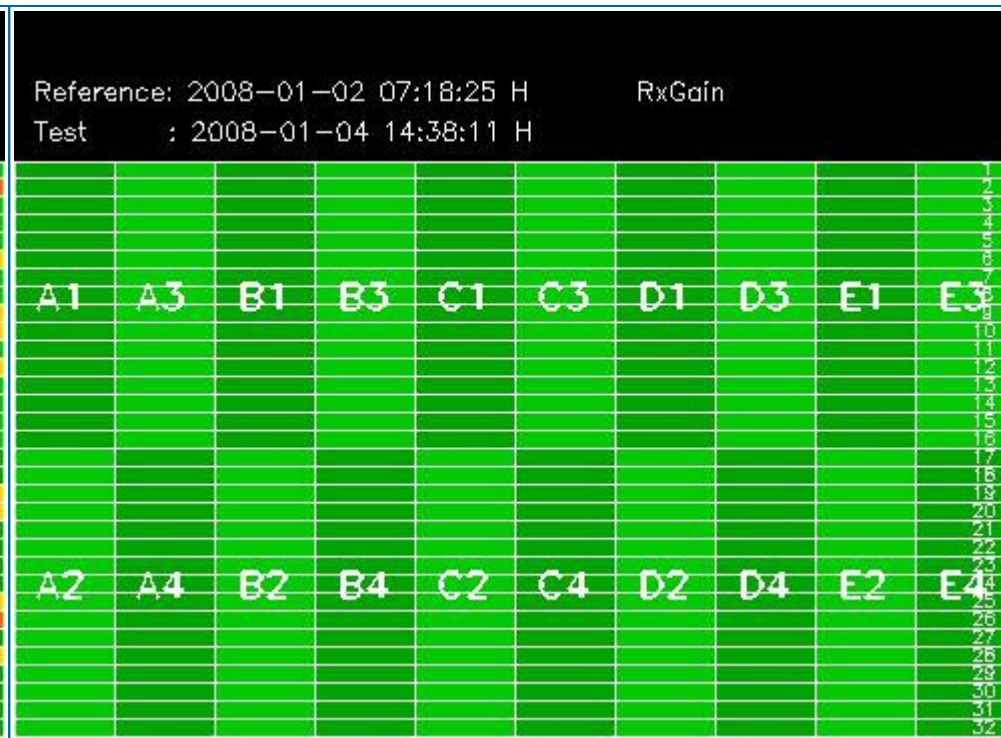

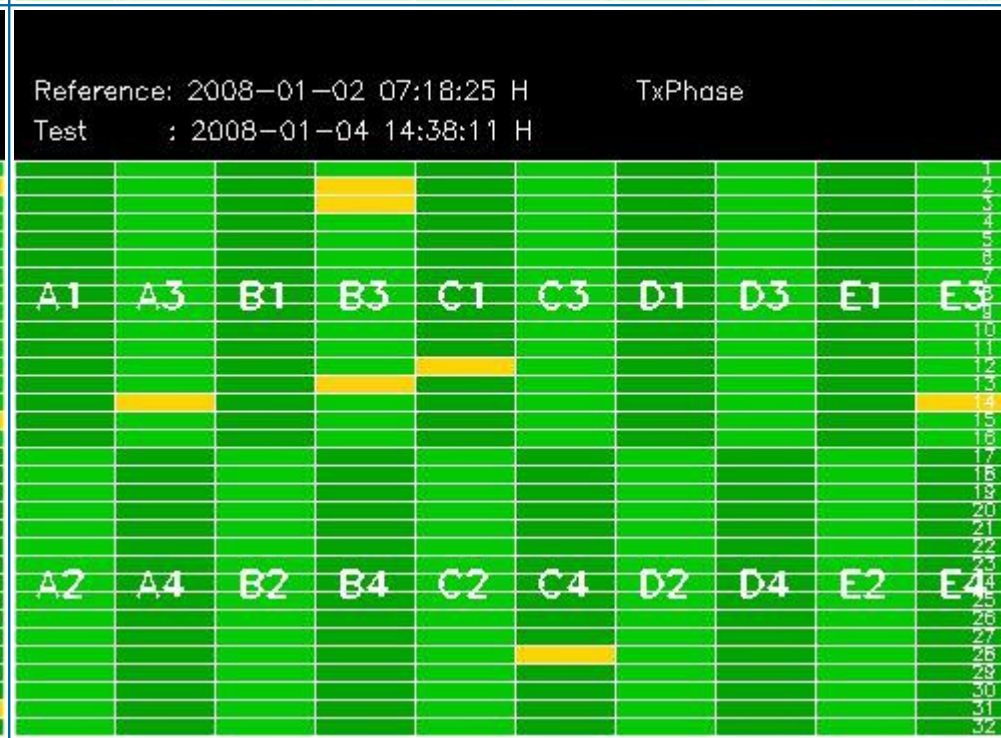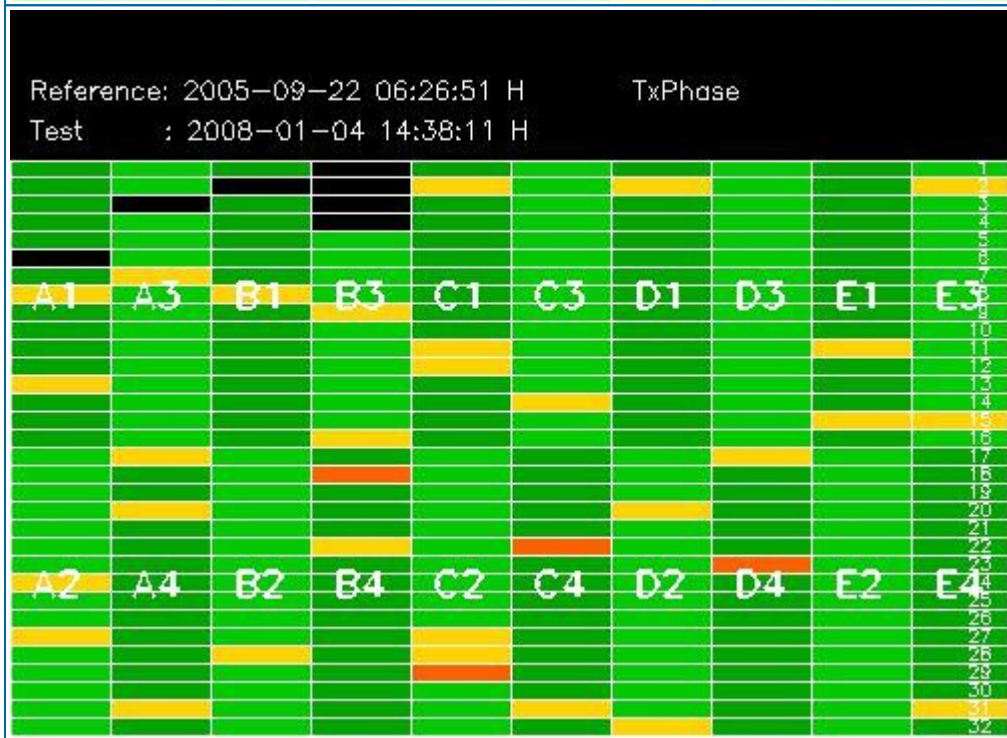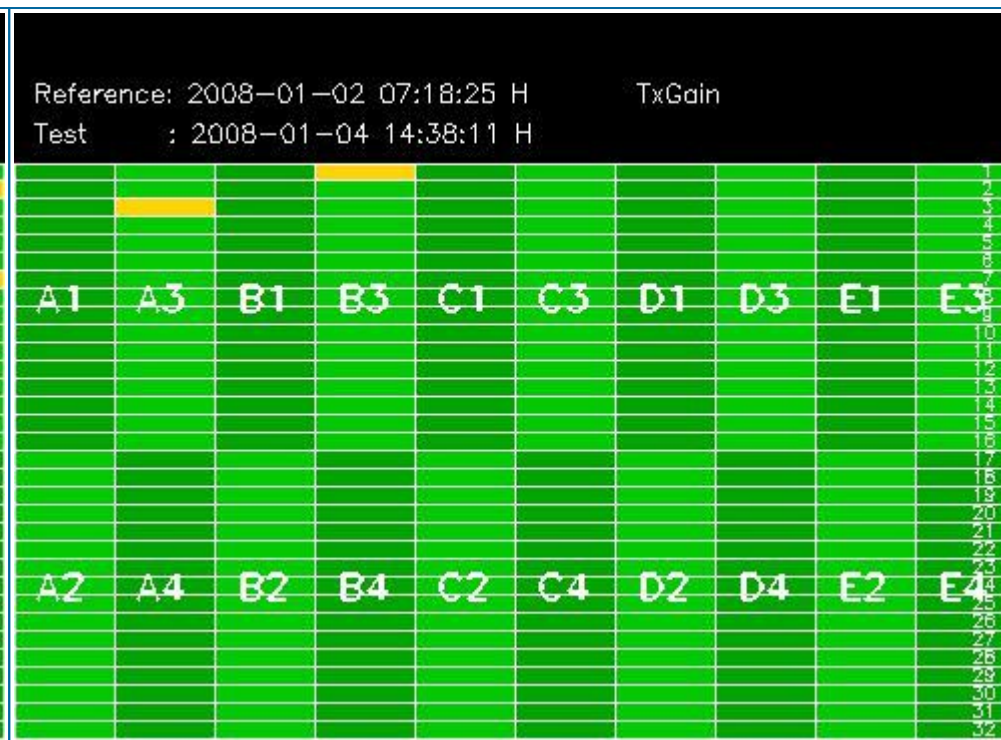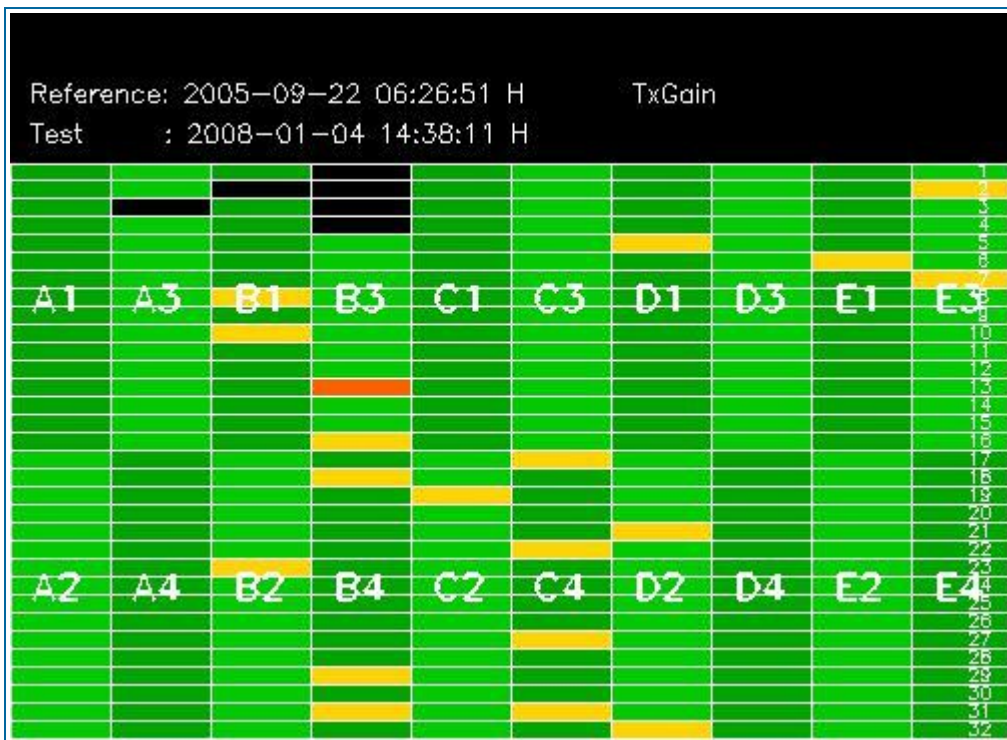

4 - CALIBRATION PULSES ANALYSIS

4.1 - Analysis for WVS IS2 V/V


4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]


Calibration pulses for WVS IS2 V/V

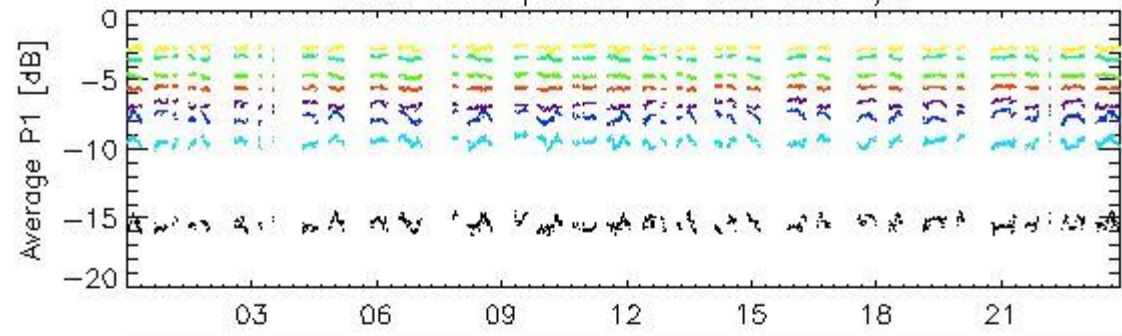


04-Jan

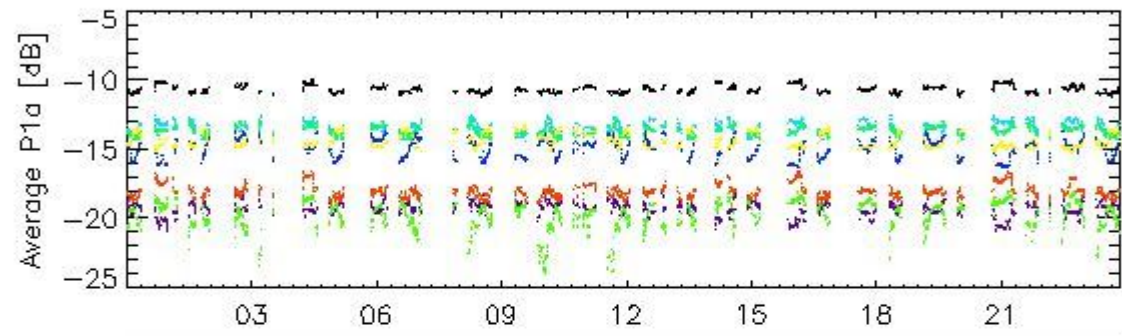

04-Jan

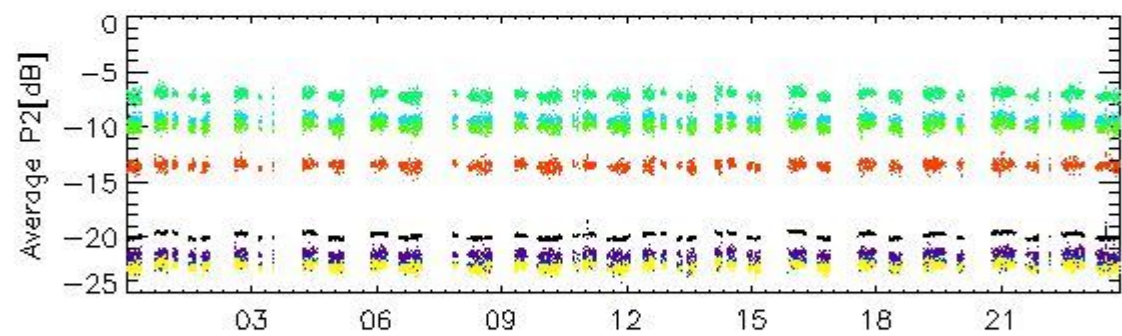


04-Jan

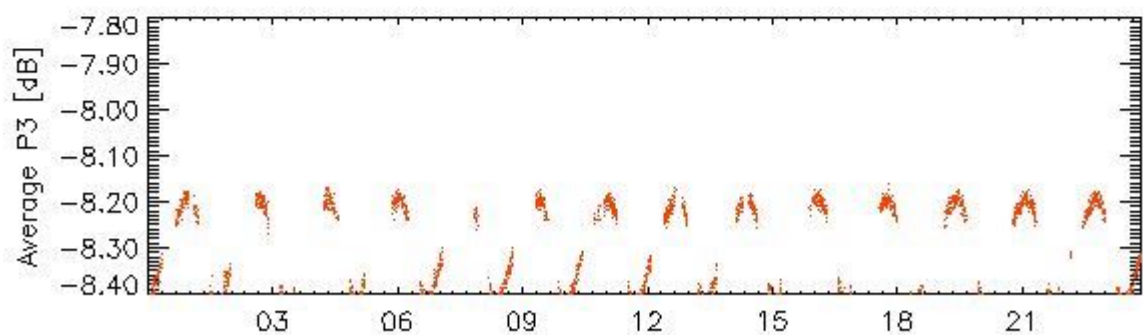

04-Jan


rows: - 1 - 5 - 9 - 13 - 17 - 21 - 25 - 29

Transmit power (P1 - P1a) for WVS IS2 V/V

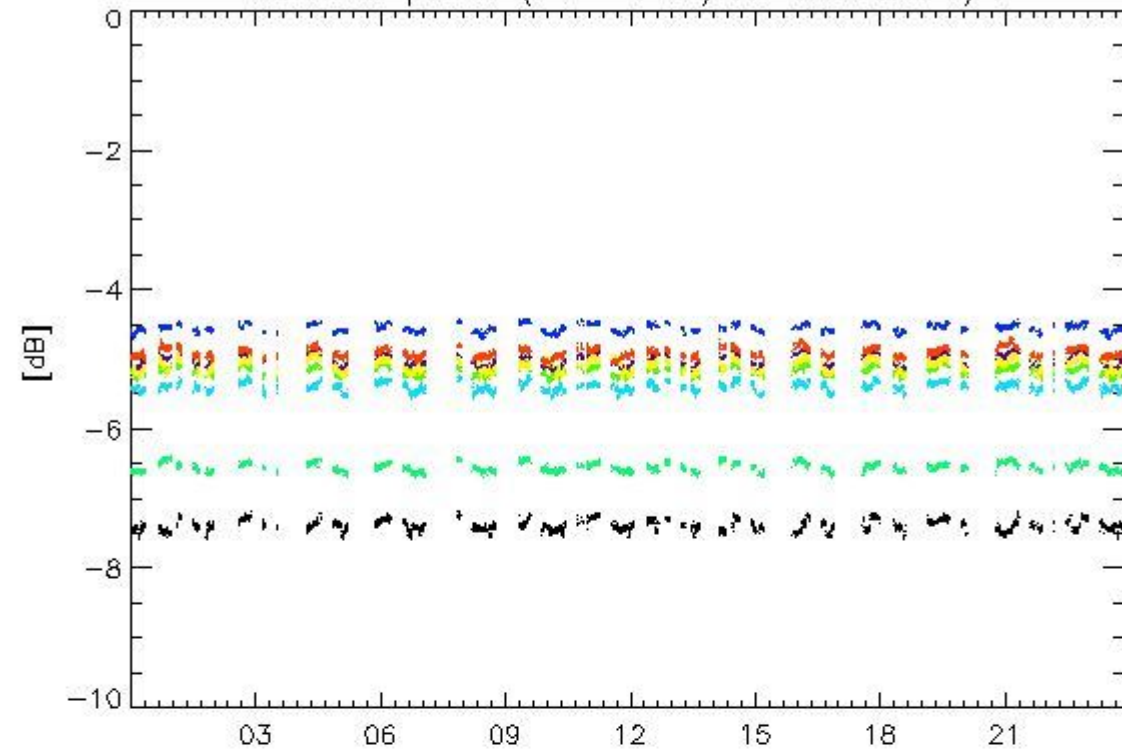

04-Jan

Transmit power (P1 - P1a) for WVS IS2 V/V

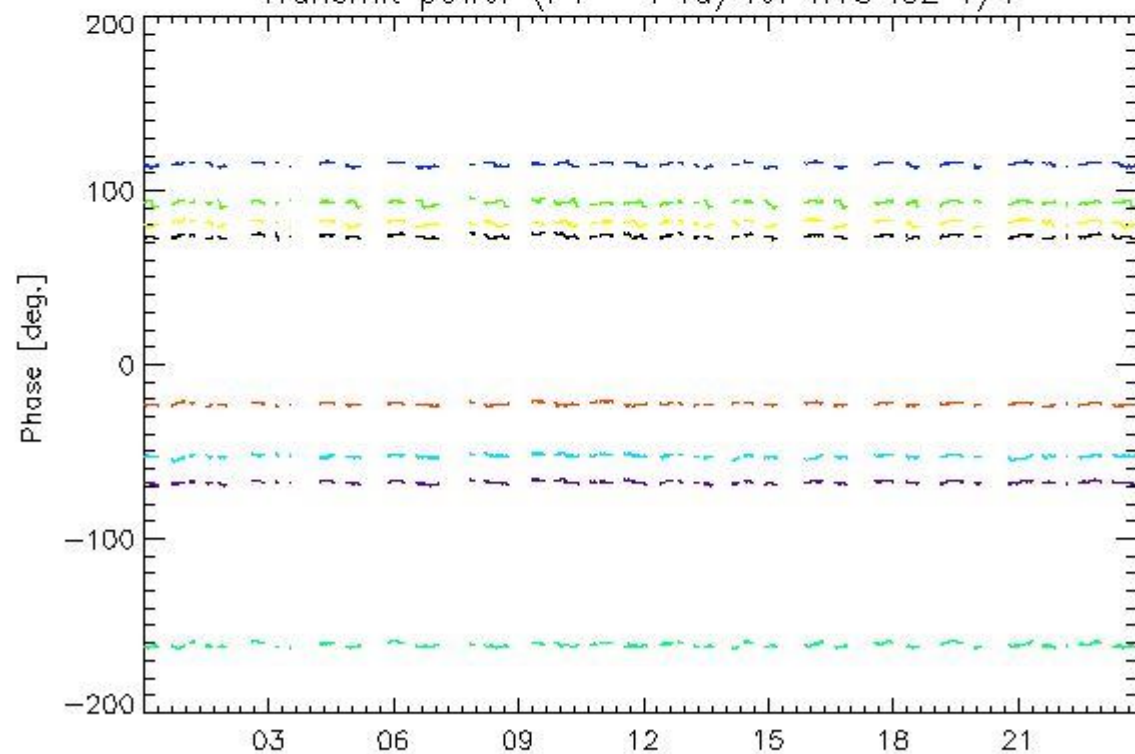


04-Jan

rows: - 1 - 5 - 9 - 13 - 17 - 21 - 25 - 29

4.1.2 - All Rows Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



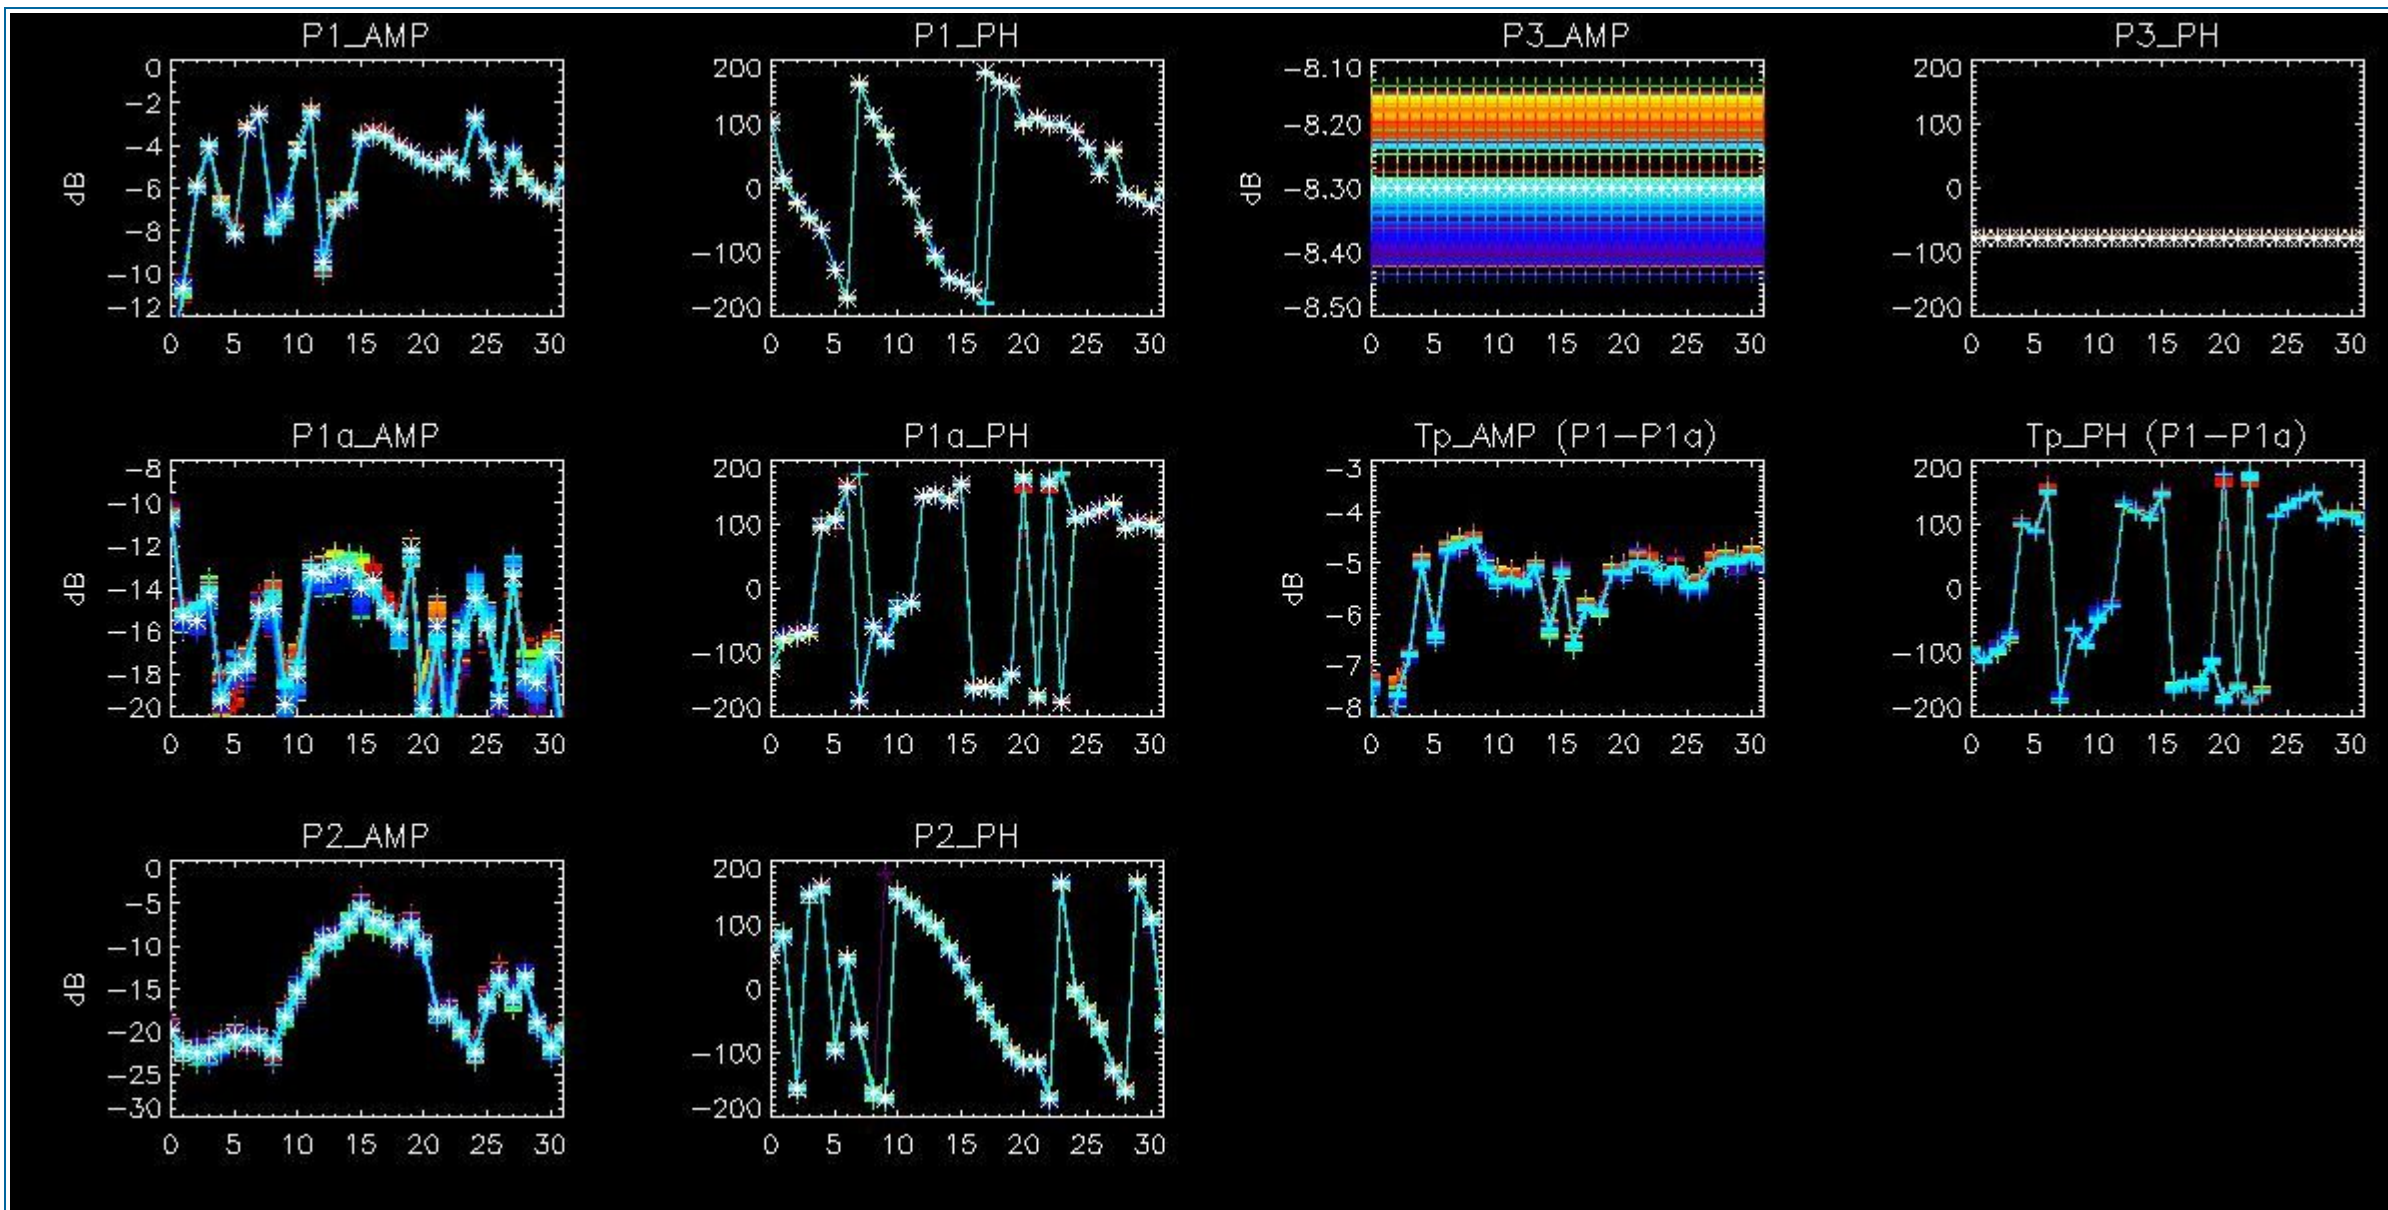

4.2 - Analysis for GM1 SS3 H/H


4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]


Calibration pulses for GM1 SS3 H/H

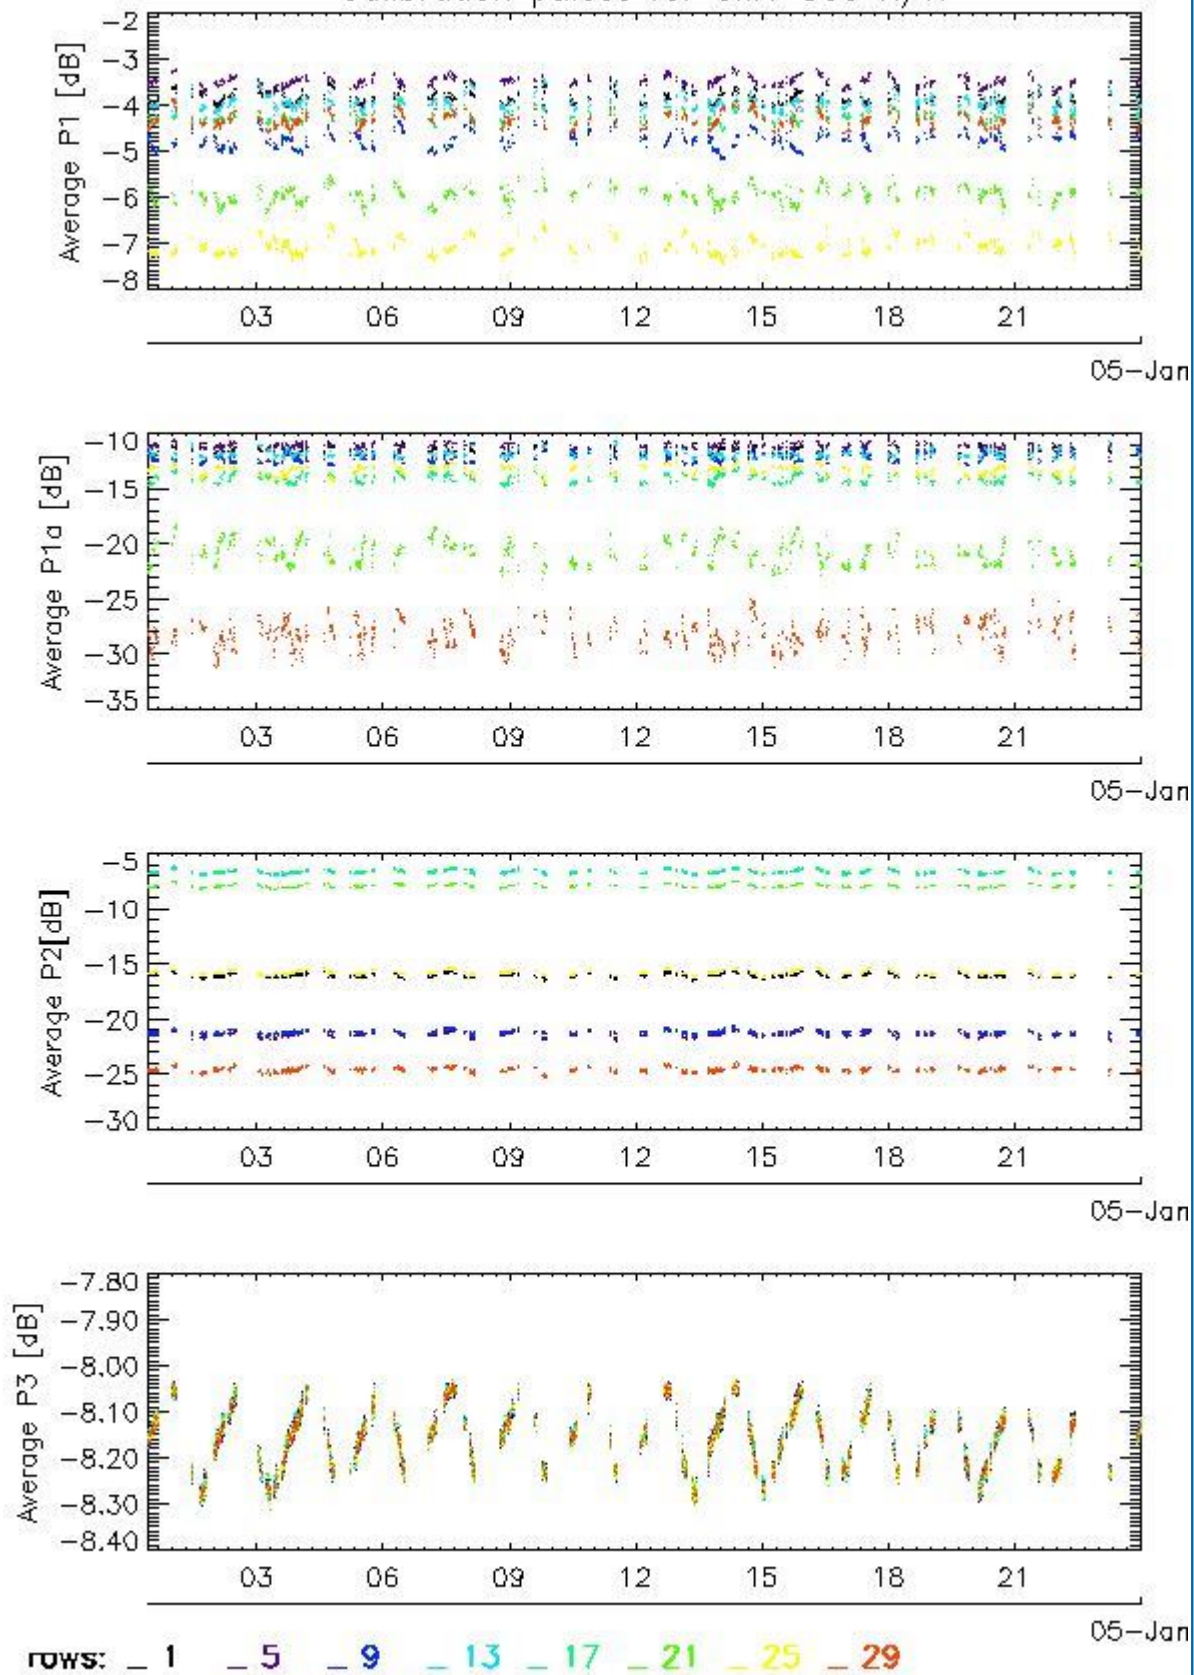

Transmit power (P1 - P1a) for GM1 SS3 H/H

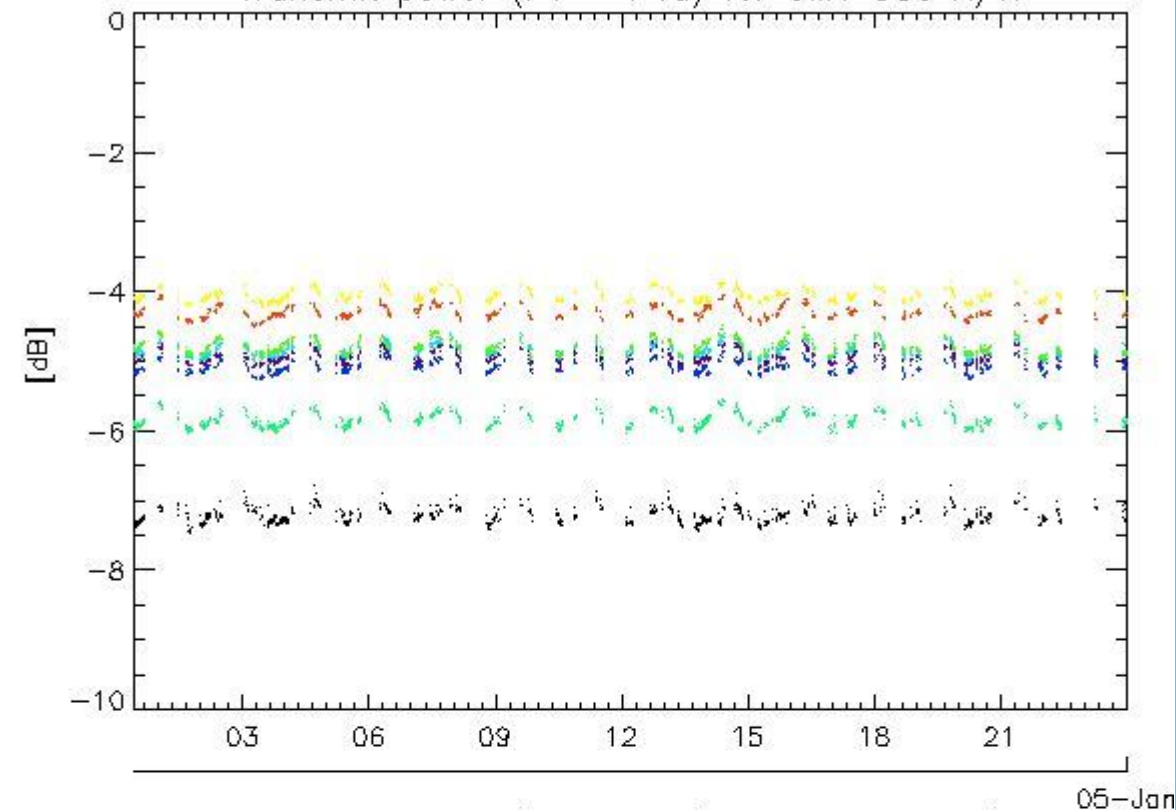



Transmit power (P1 - P1a) for GM1 SS3 H/H

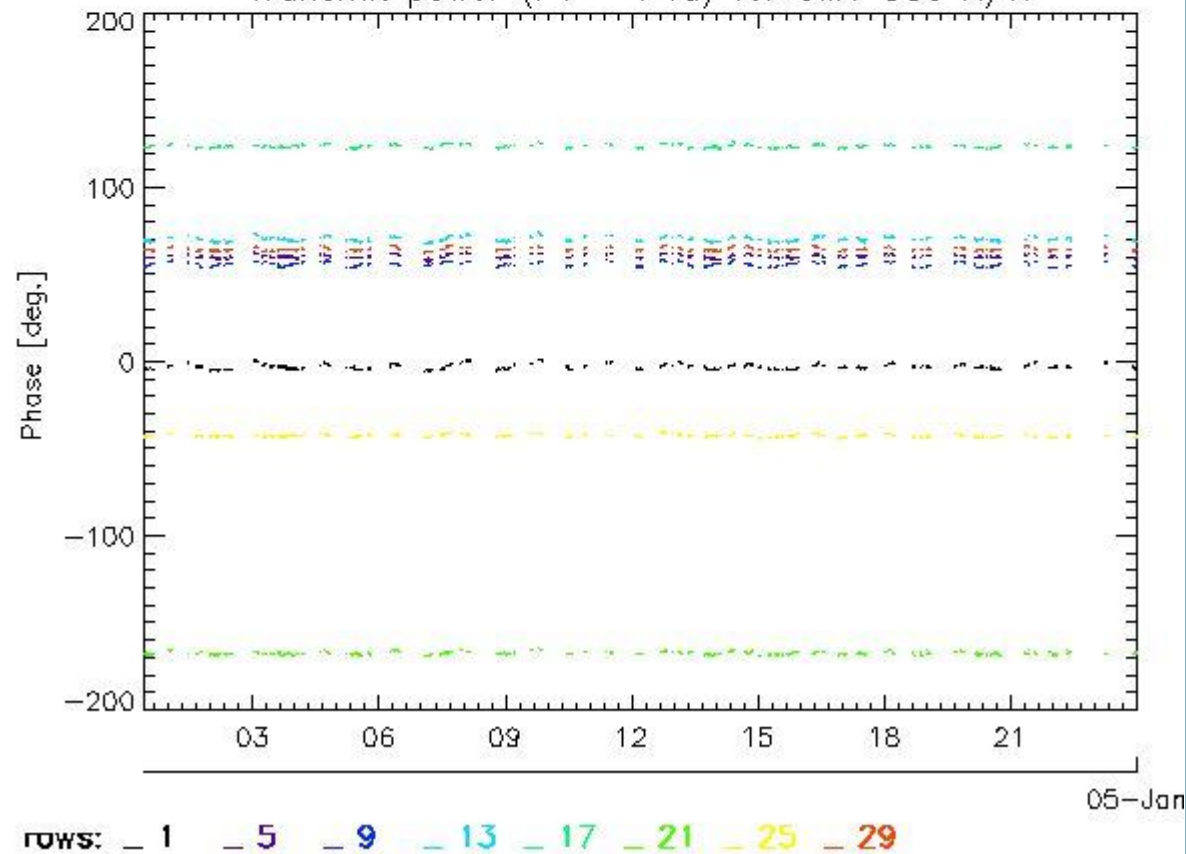

4.2.2 - All Rows Analysis for GM1 SS3 H/H

[[BACK TO MENU](#)]



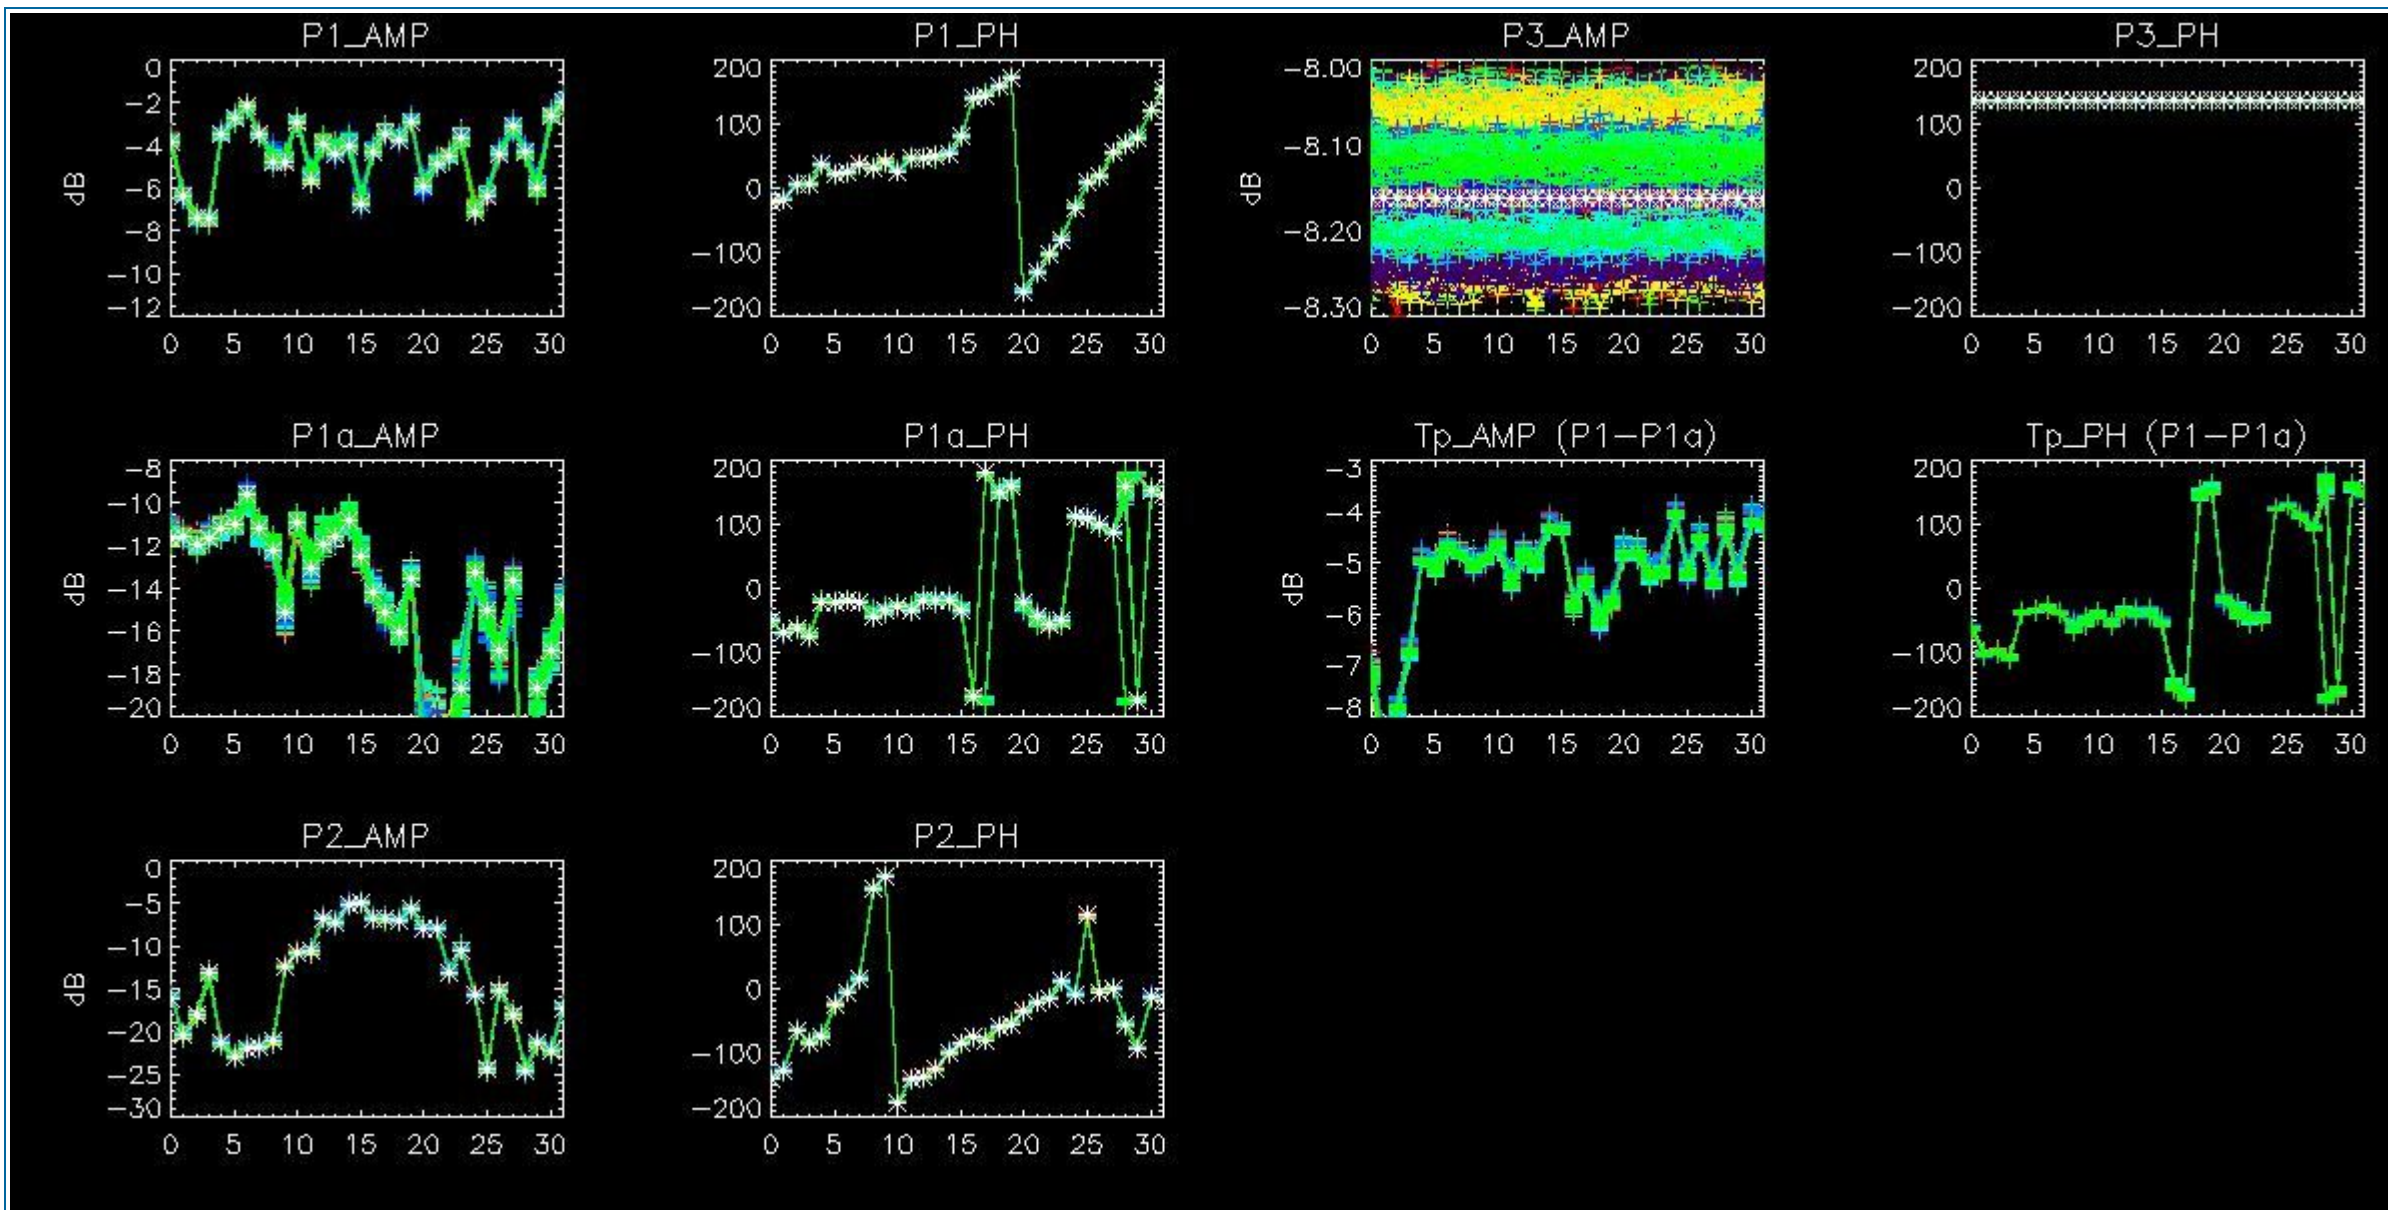


5 - DOPPLER ANALYSIS

5.1 - Analysis for WVS IS2 V/V

5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]




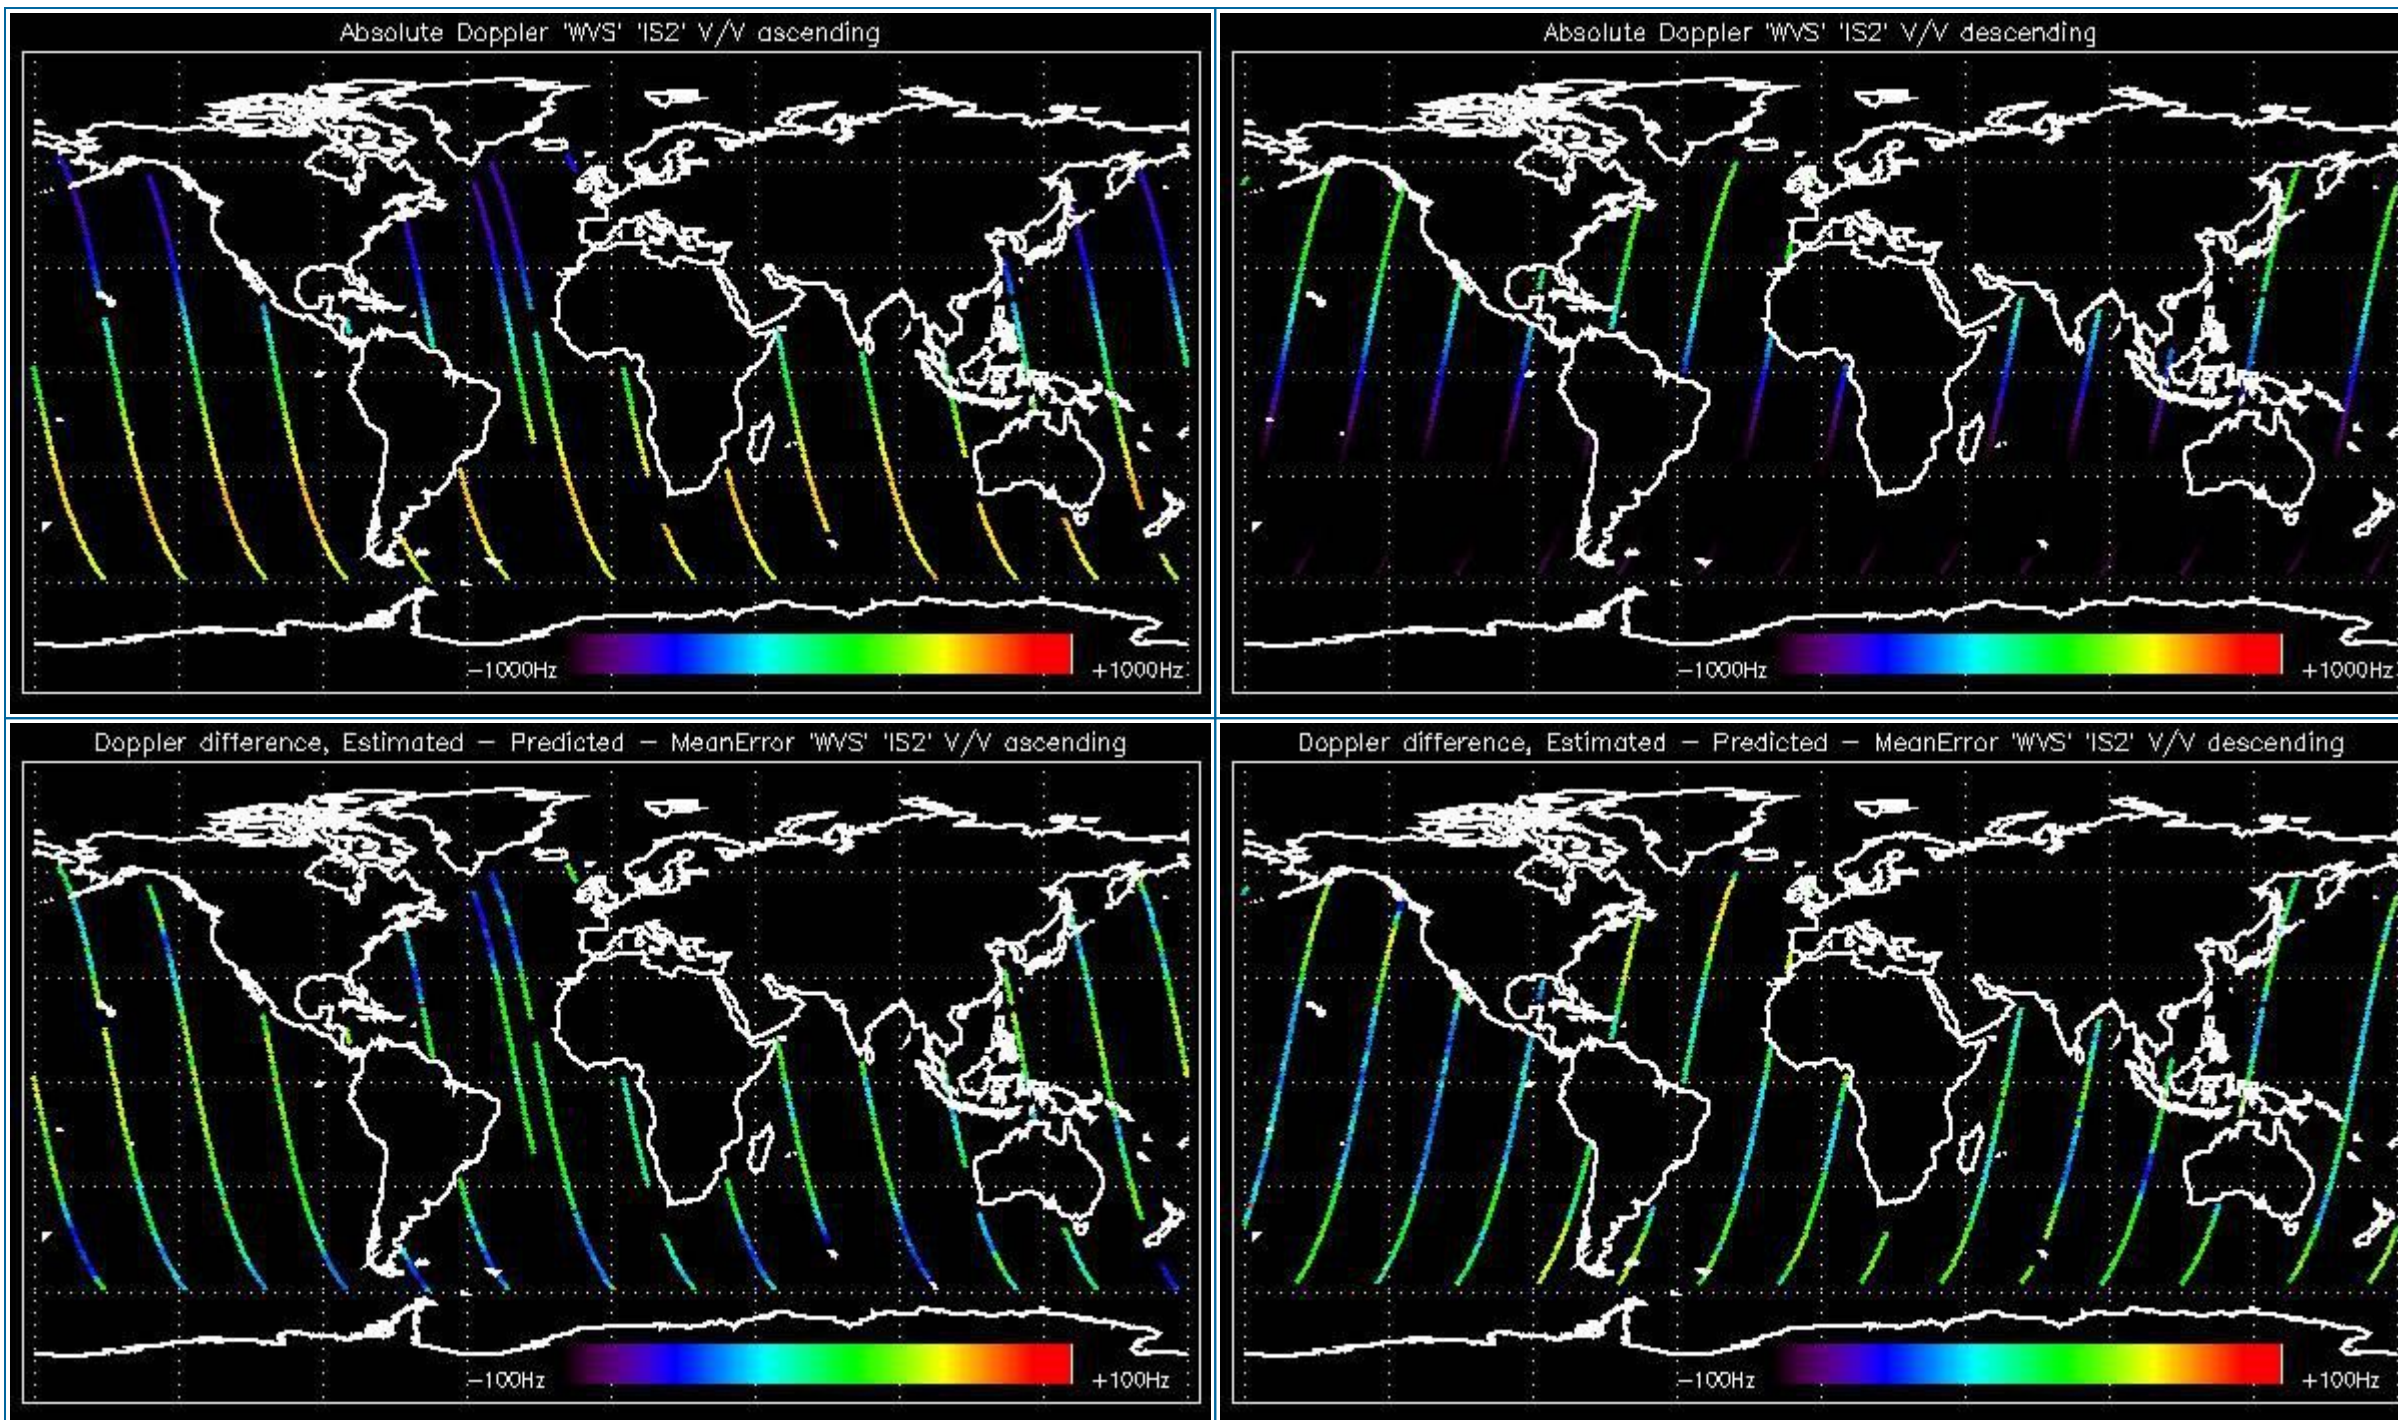

5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



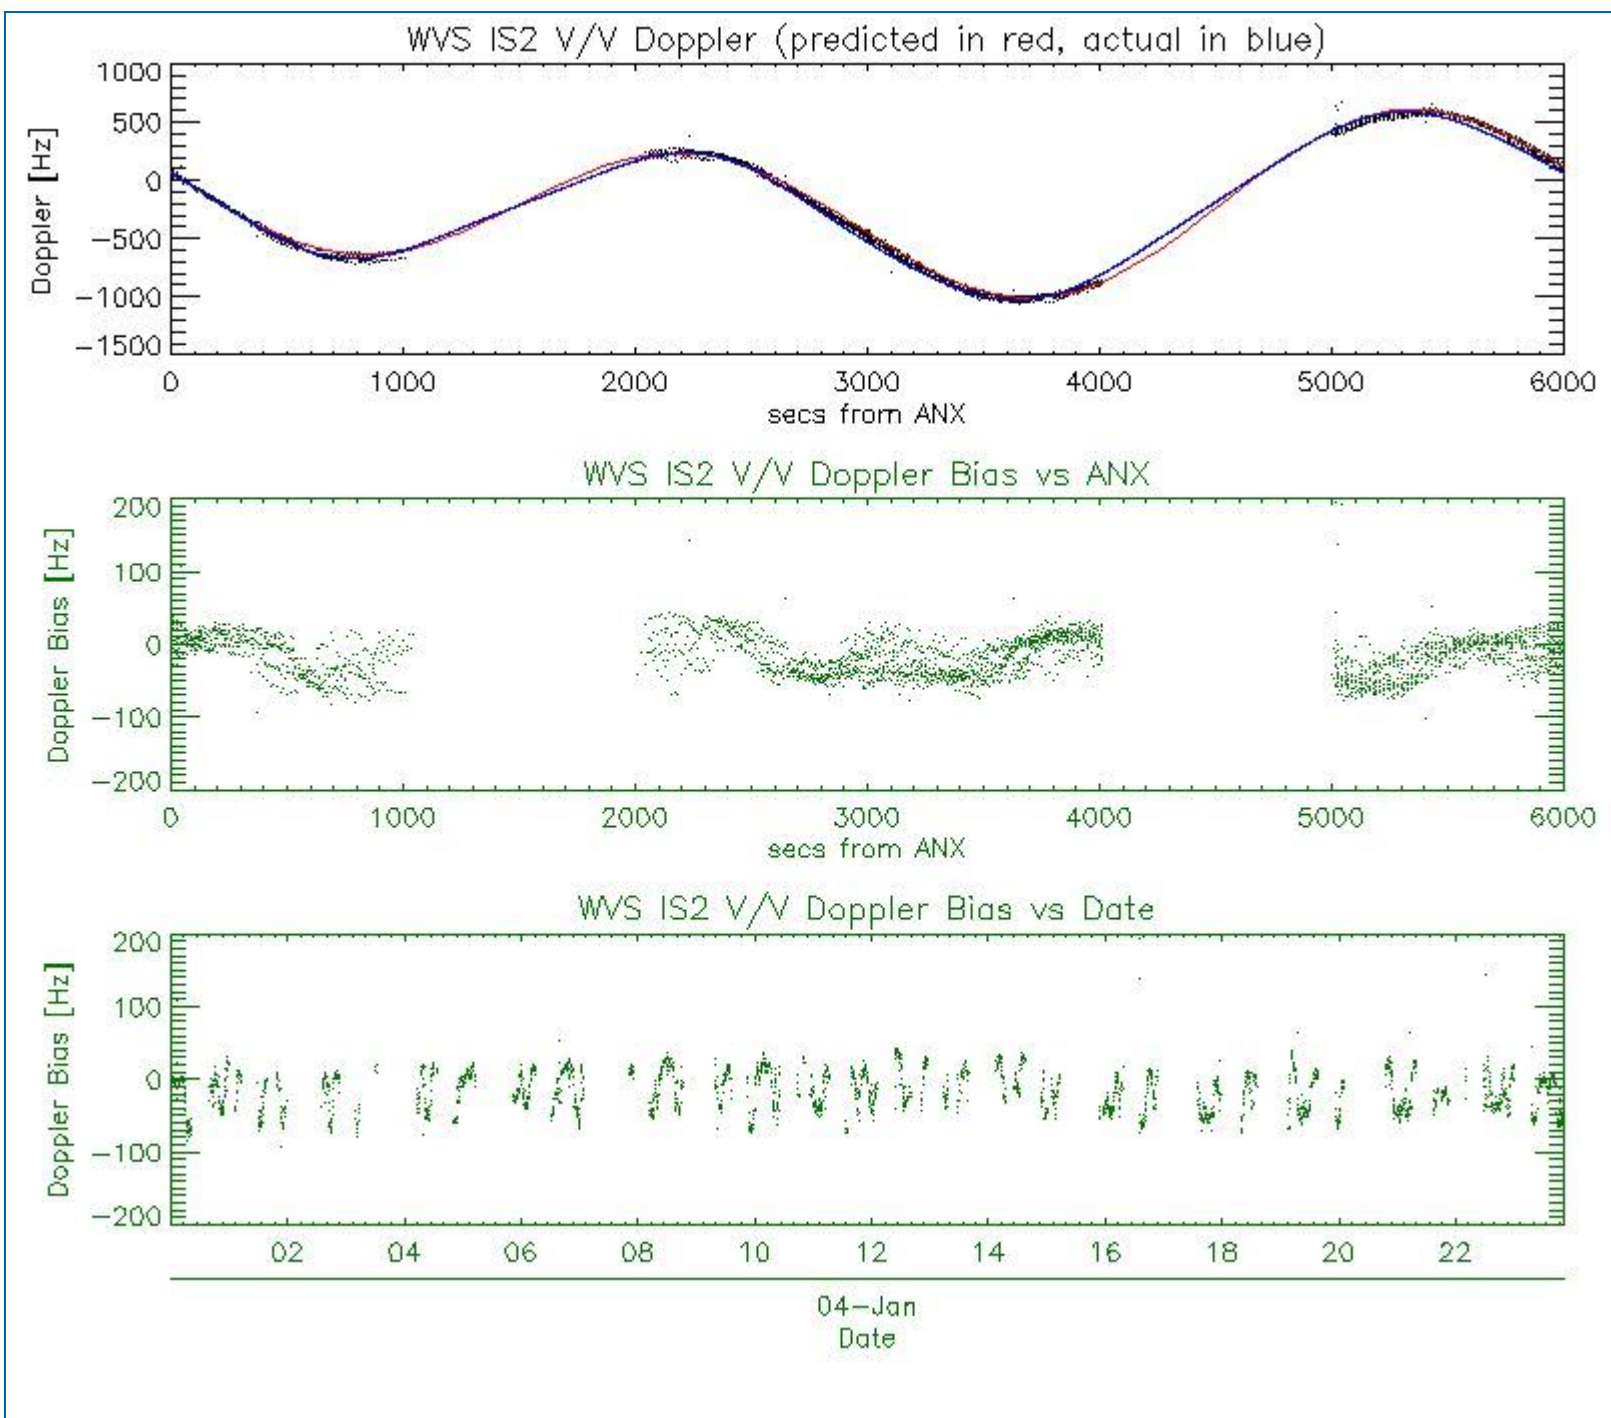


5.2 - Analysis for GM1 SS1 H/H

5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




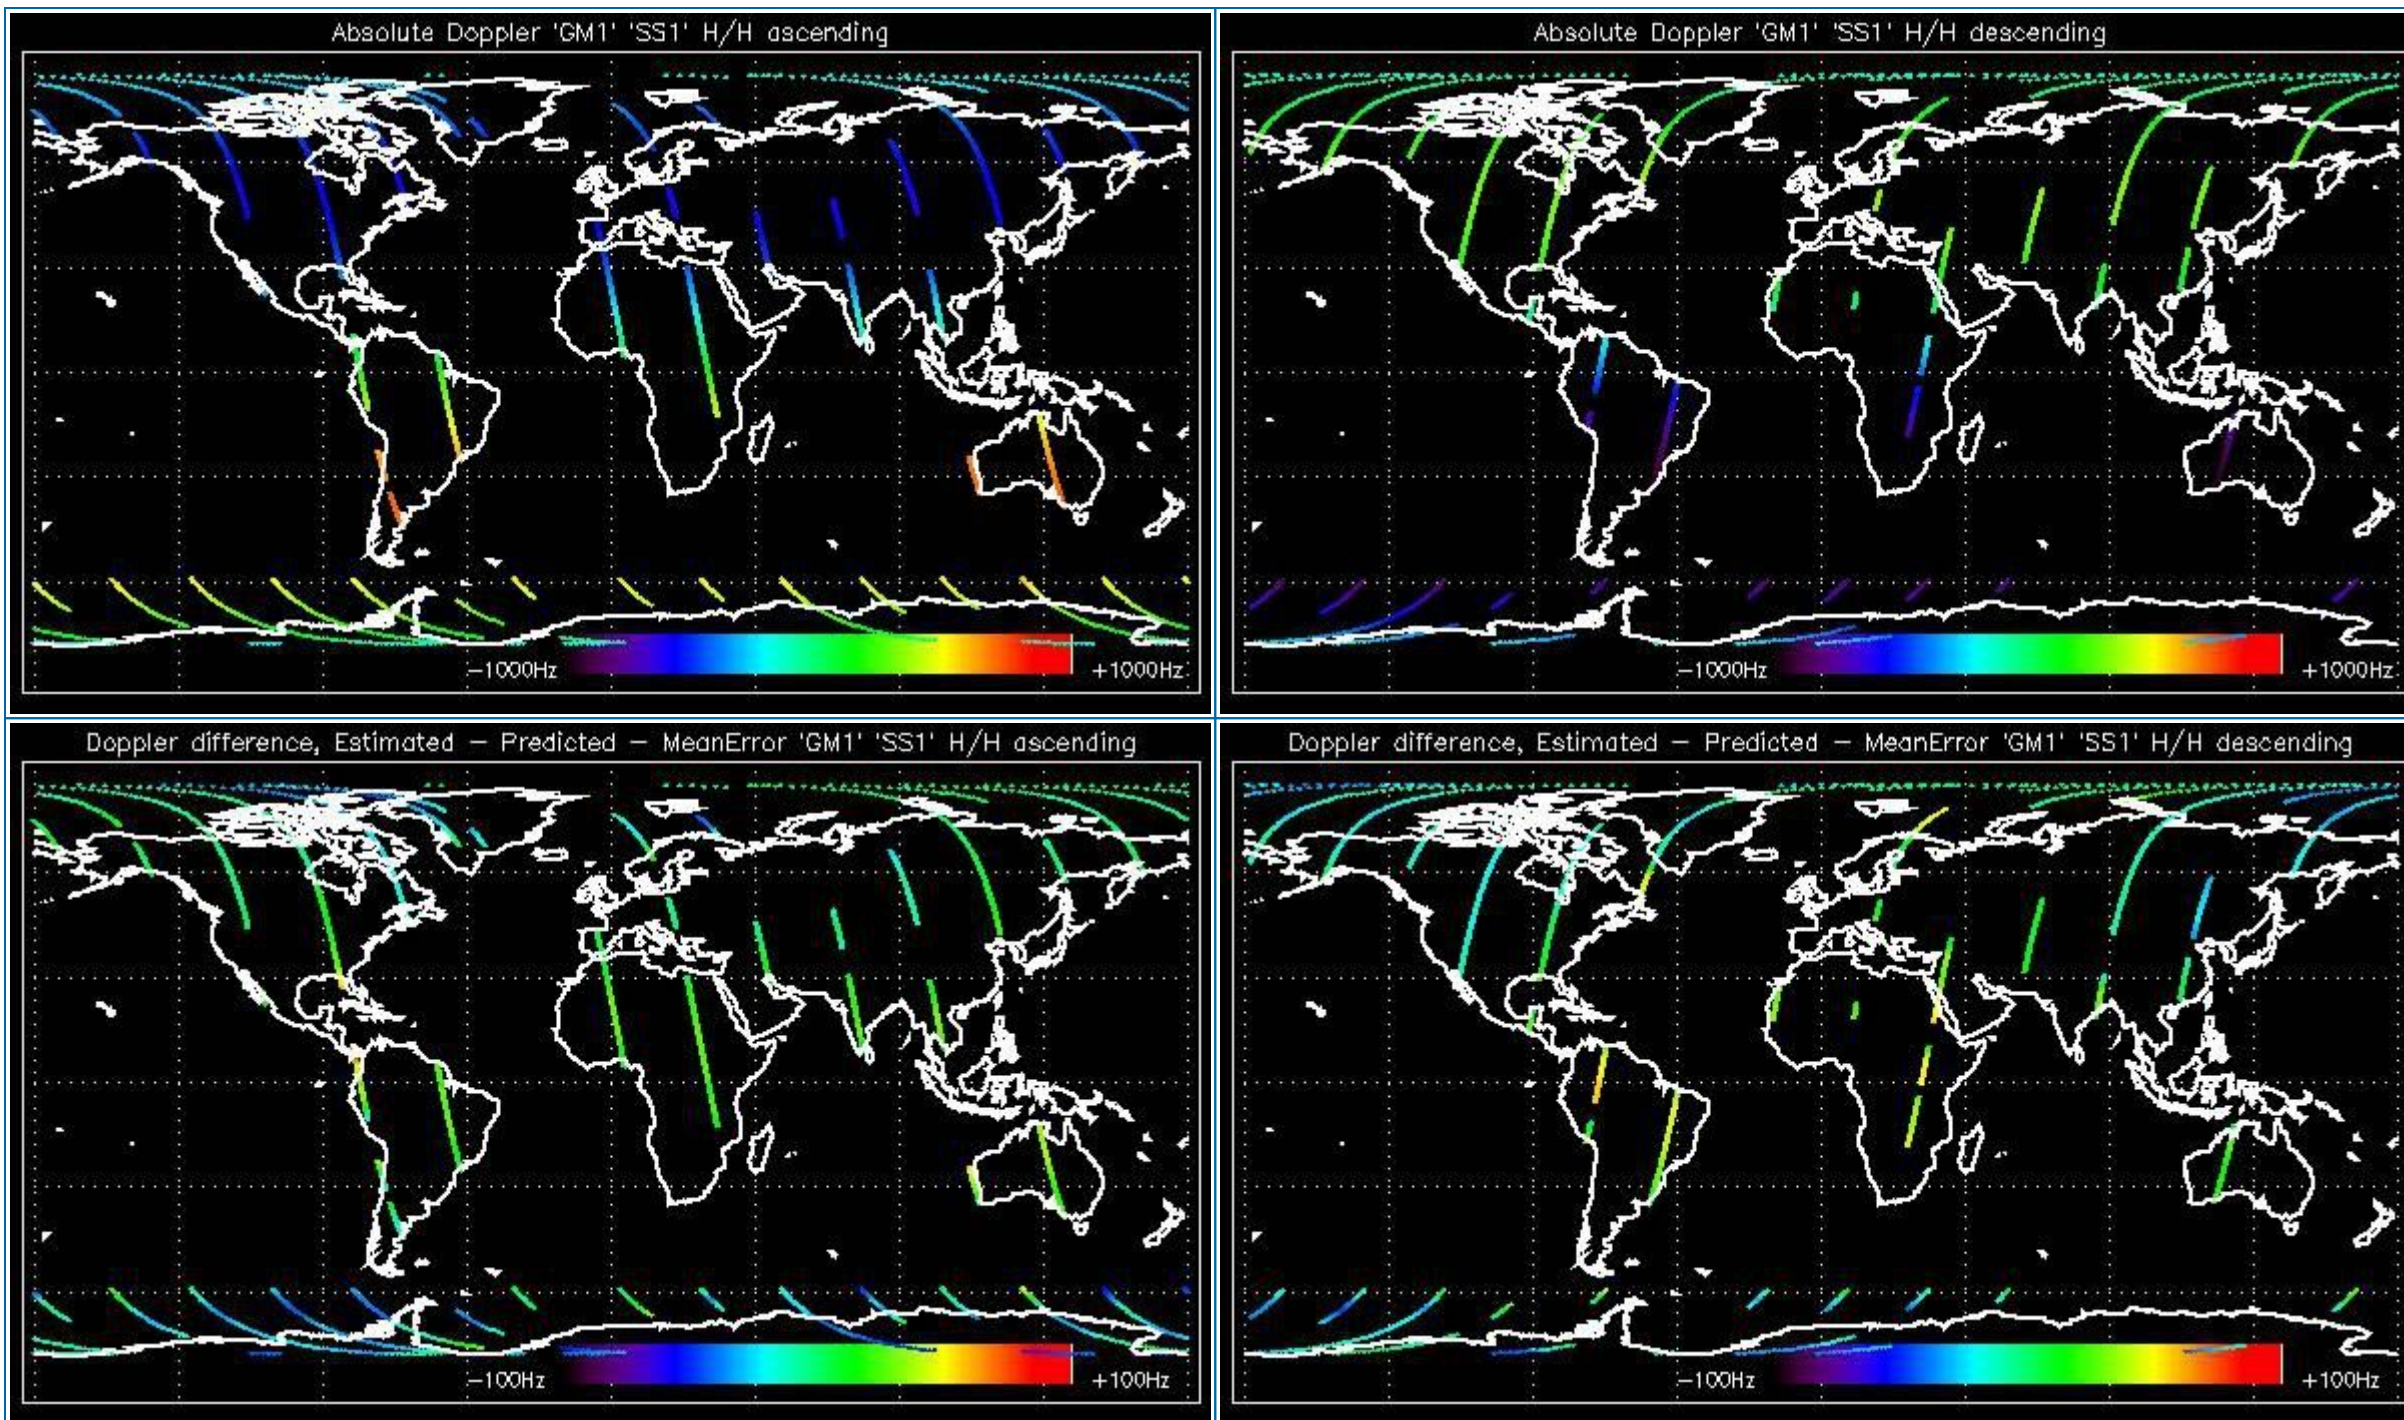

5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




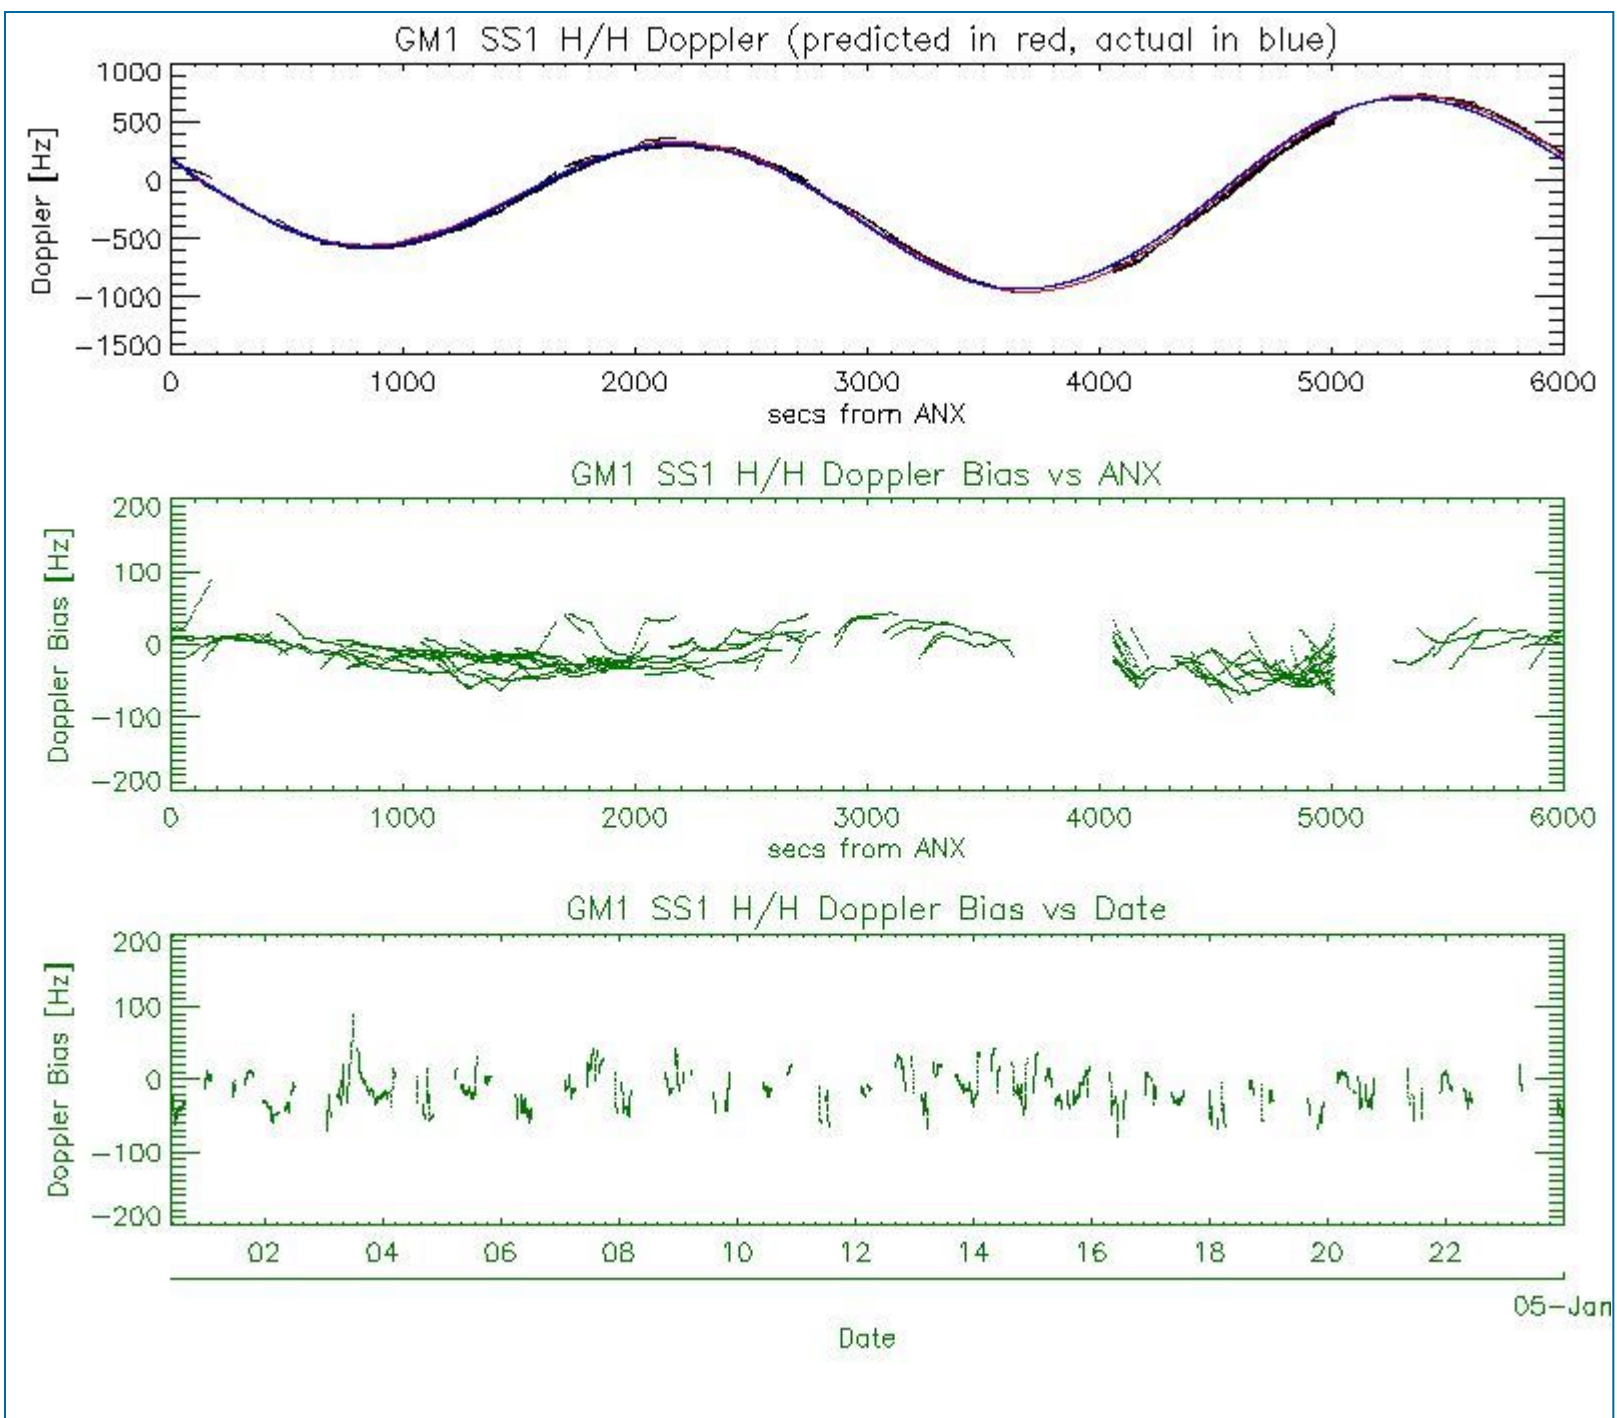

5.3 - Doppler JUMPS Analysis for WSM

[[BACK TO MENU](#)]



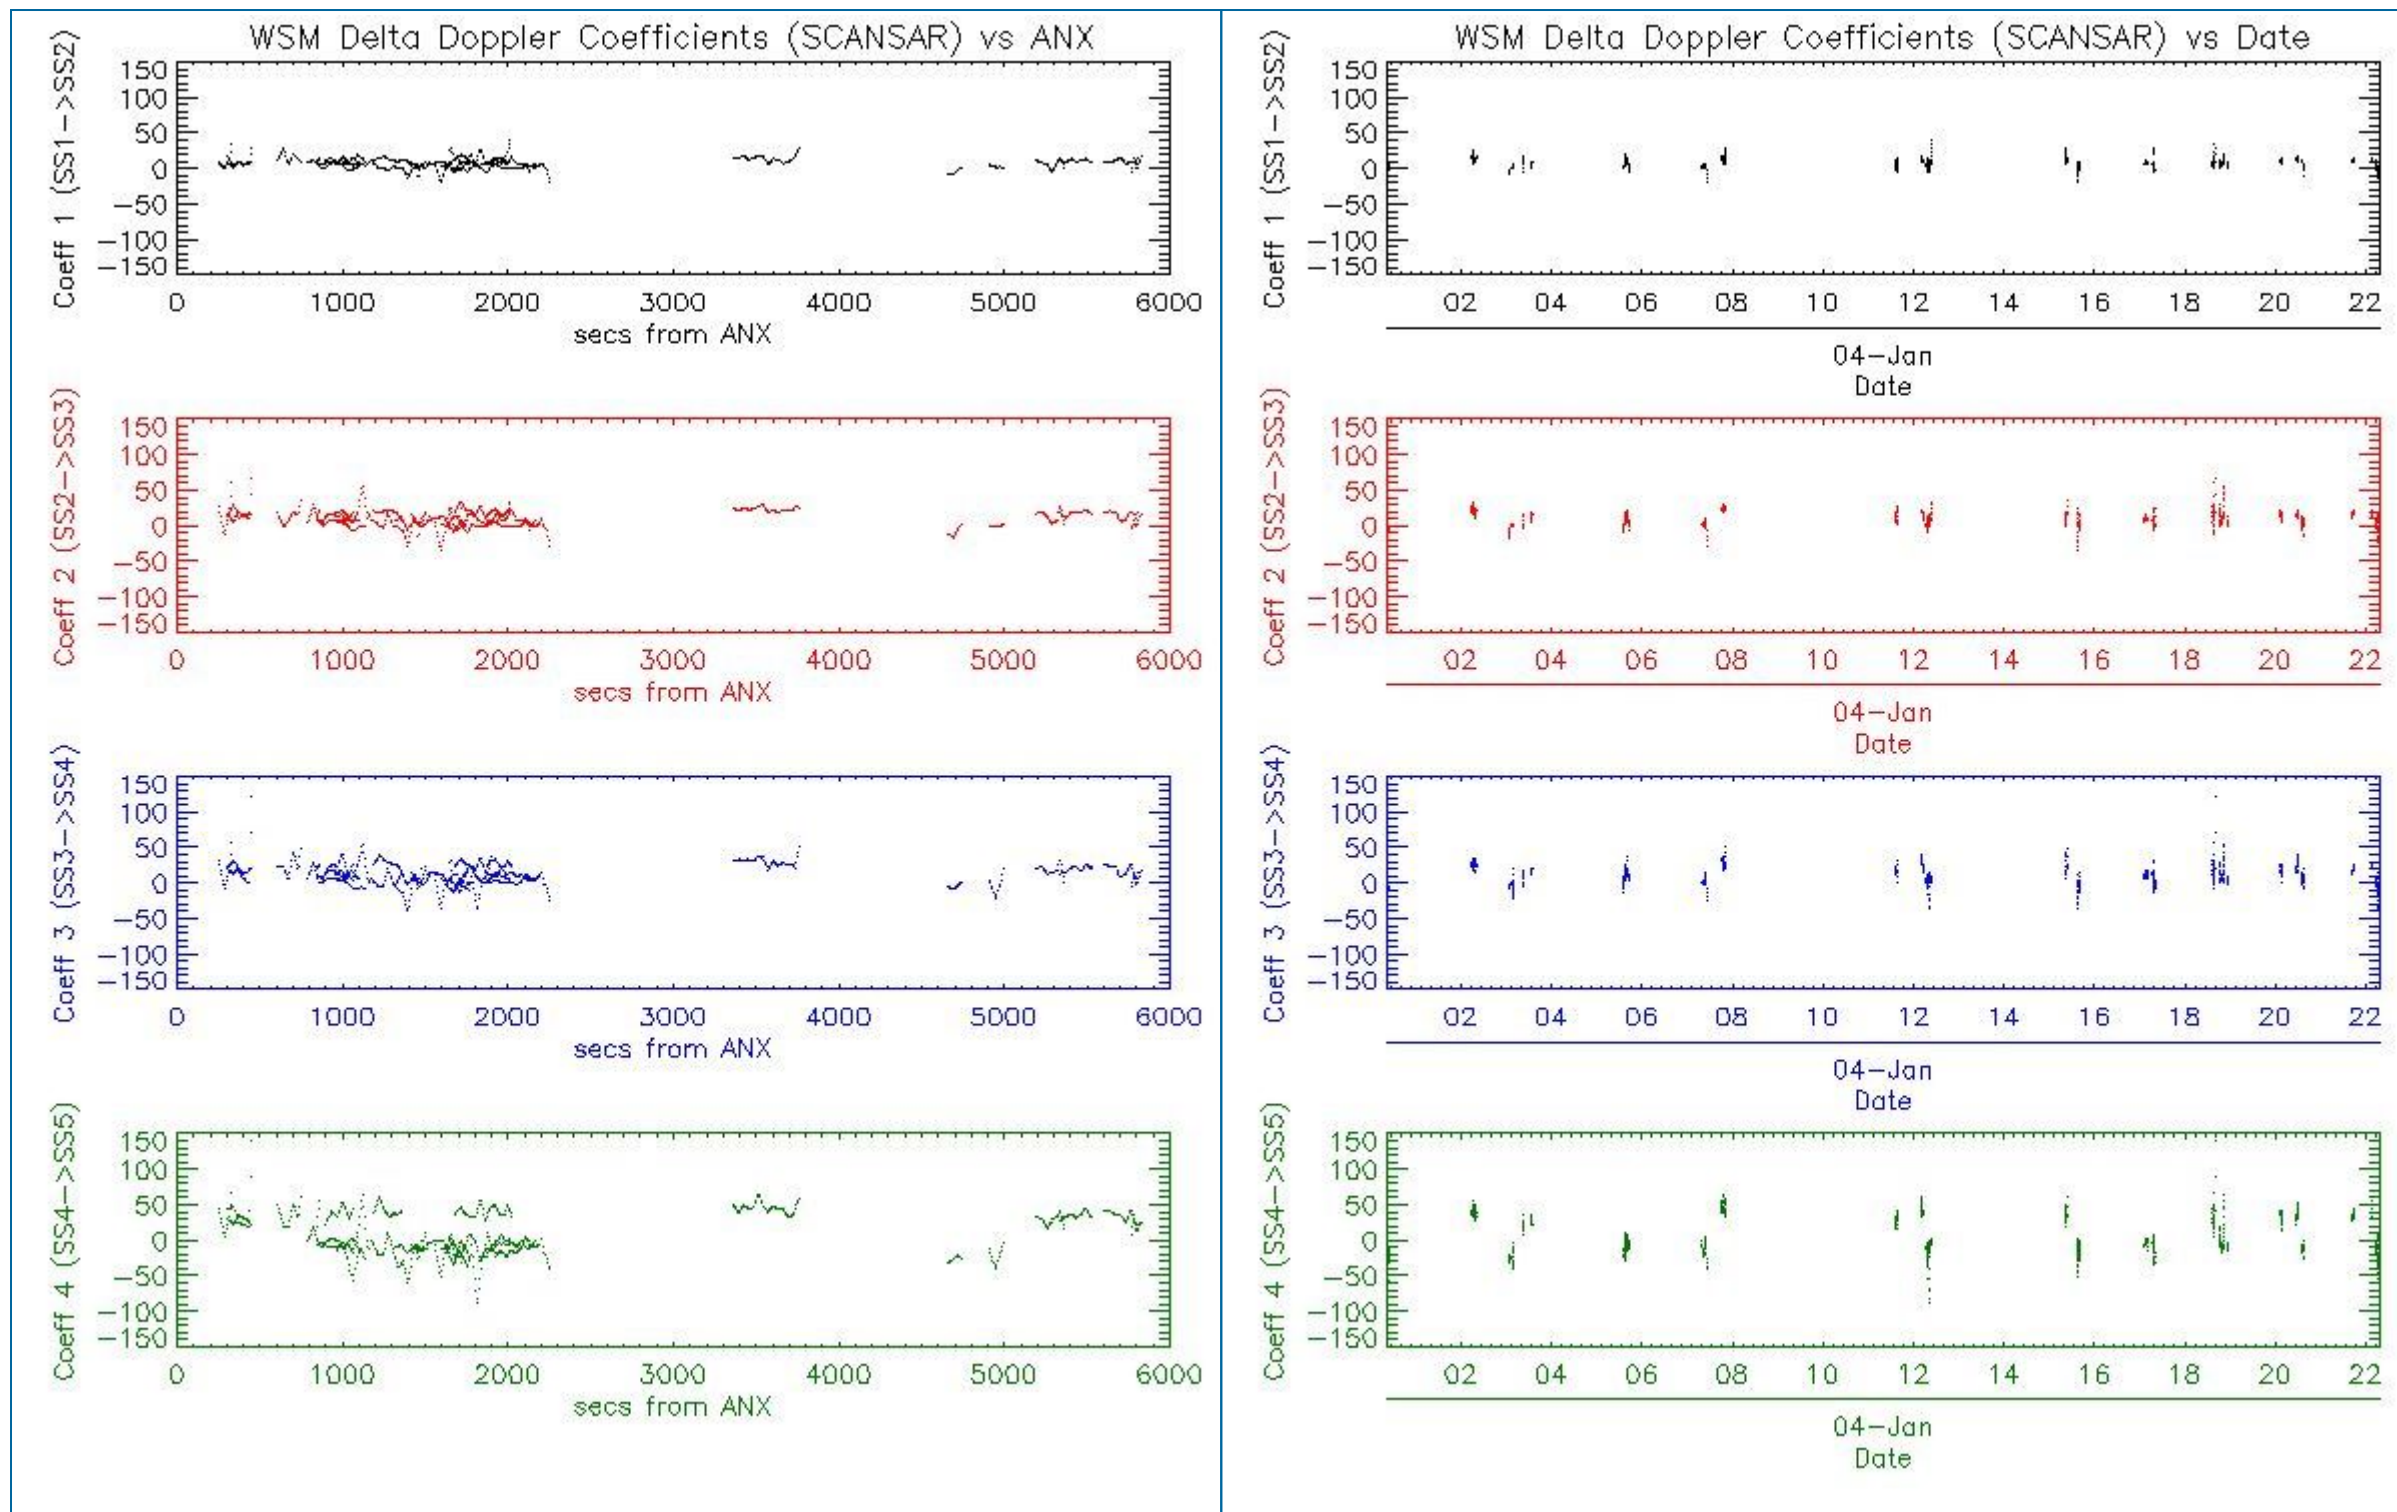




6 - CHIRP ANALYSIS

6.1 - Analysis for WSM SS1 H/H

6.1.1 - ScaleFactor

[[BACK TO MENU](#)]





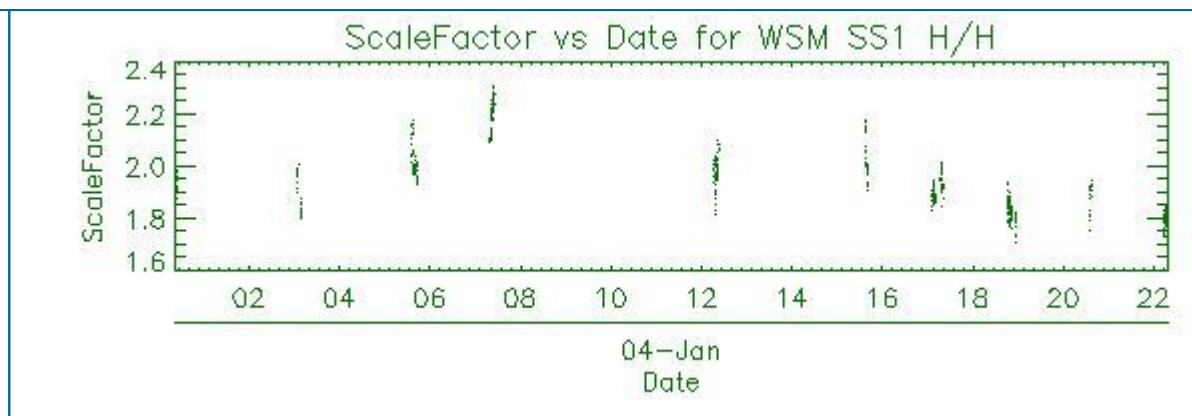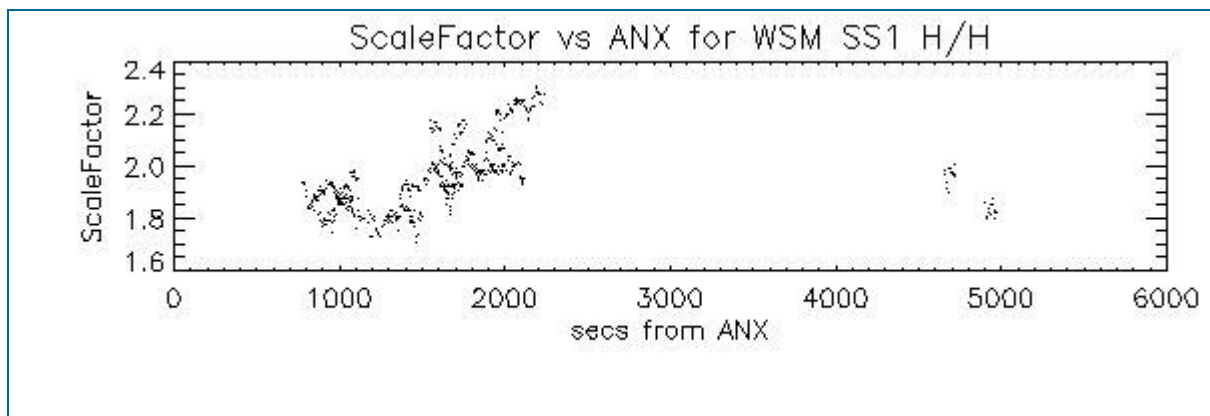

6.2 - Analysis for WSM SS1 V/V

6.2.1 - ScaleFactor

[[BACK TO MENU](#)]


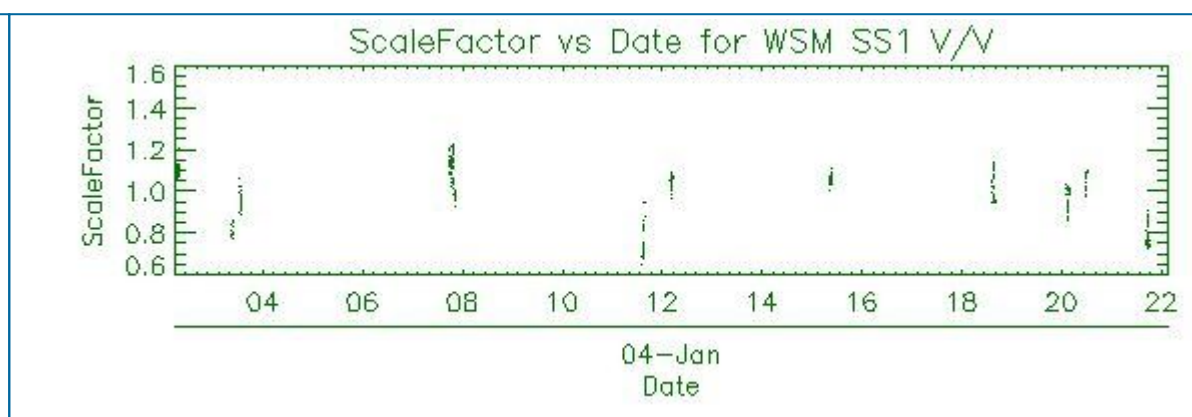
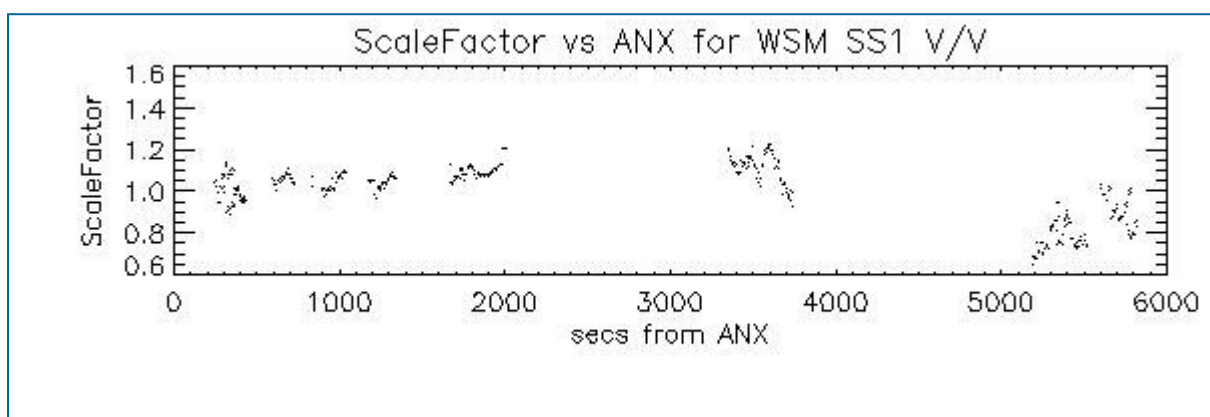


7 - RAW DATA ANALYSIS

7.1 - Analysis for WVS

[[BACK TO MENU](#)]

--	--	--

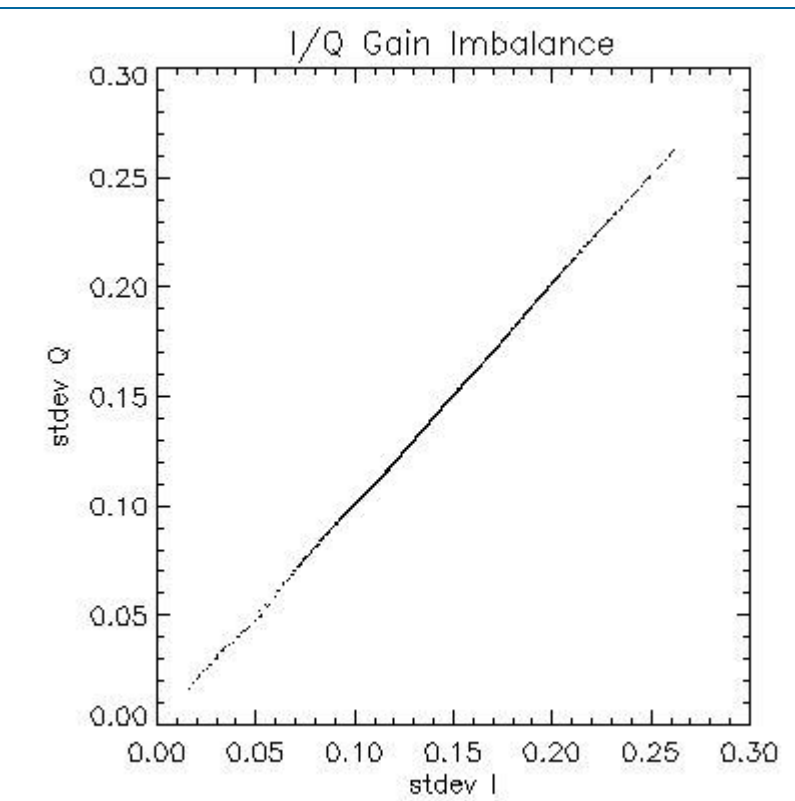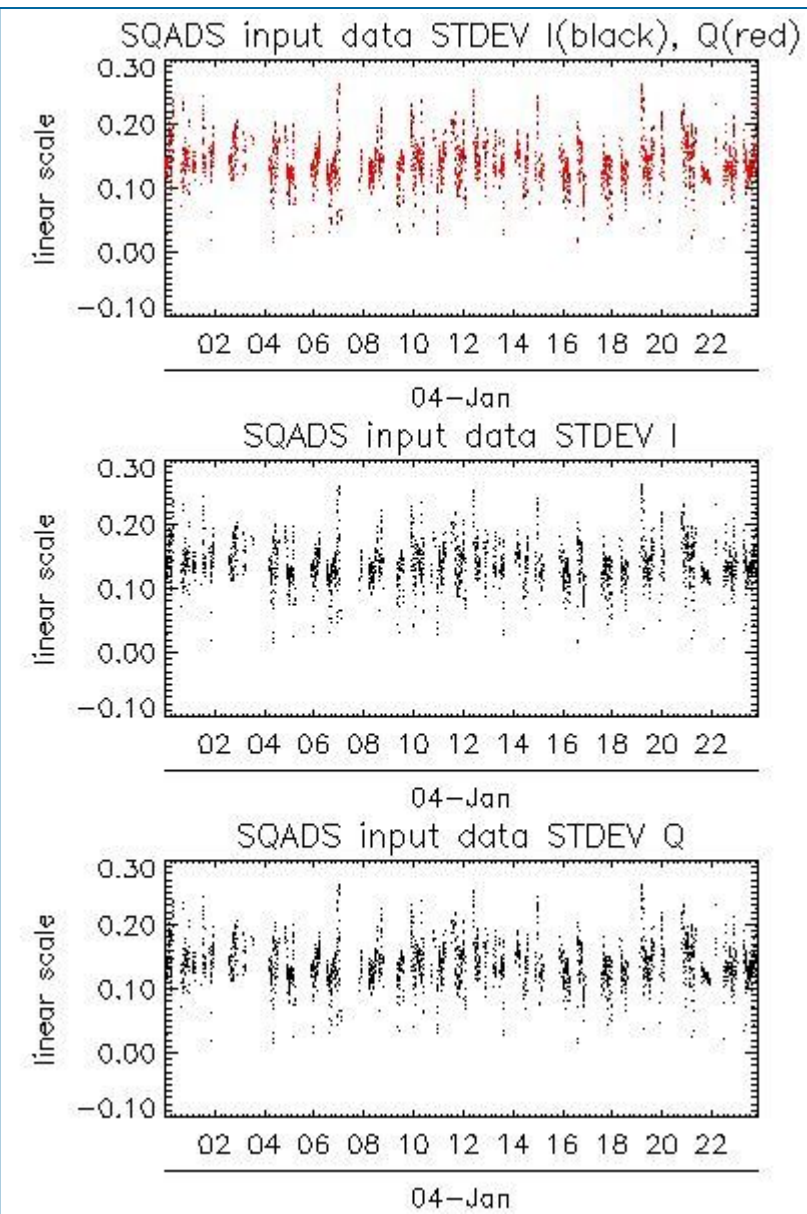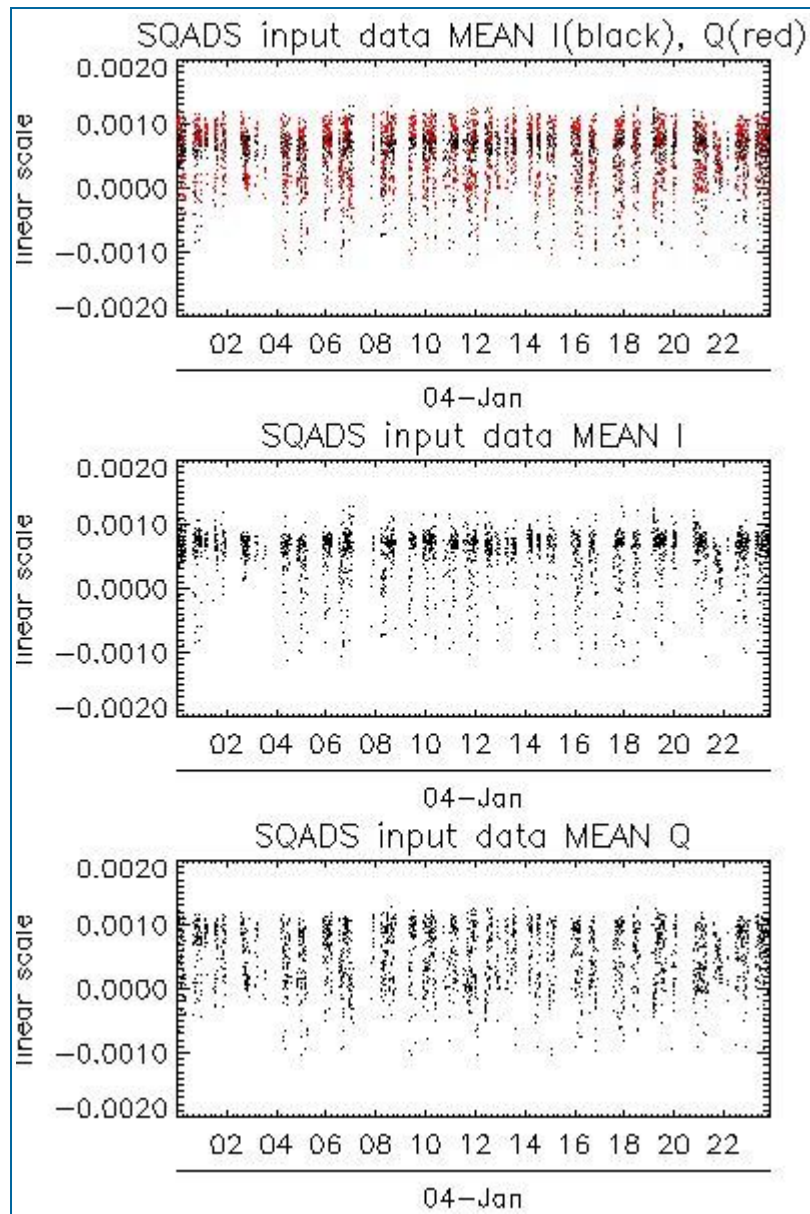


Channel	Statistics	DSS-B
MEAN I	mean	0.000536834
	stdev	1.63662e-07
MEAN Q	mean	0.000508260
	stdev	2.20277e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.139711
	stdev	0.00119385
STDEV Q	mean	0.140109
	stdev	0.00121448

7.2 - Analysis for IMM

[[BACK TO MENU](#)]



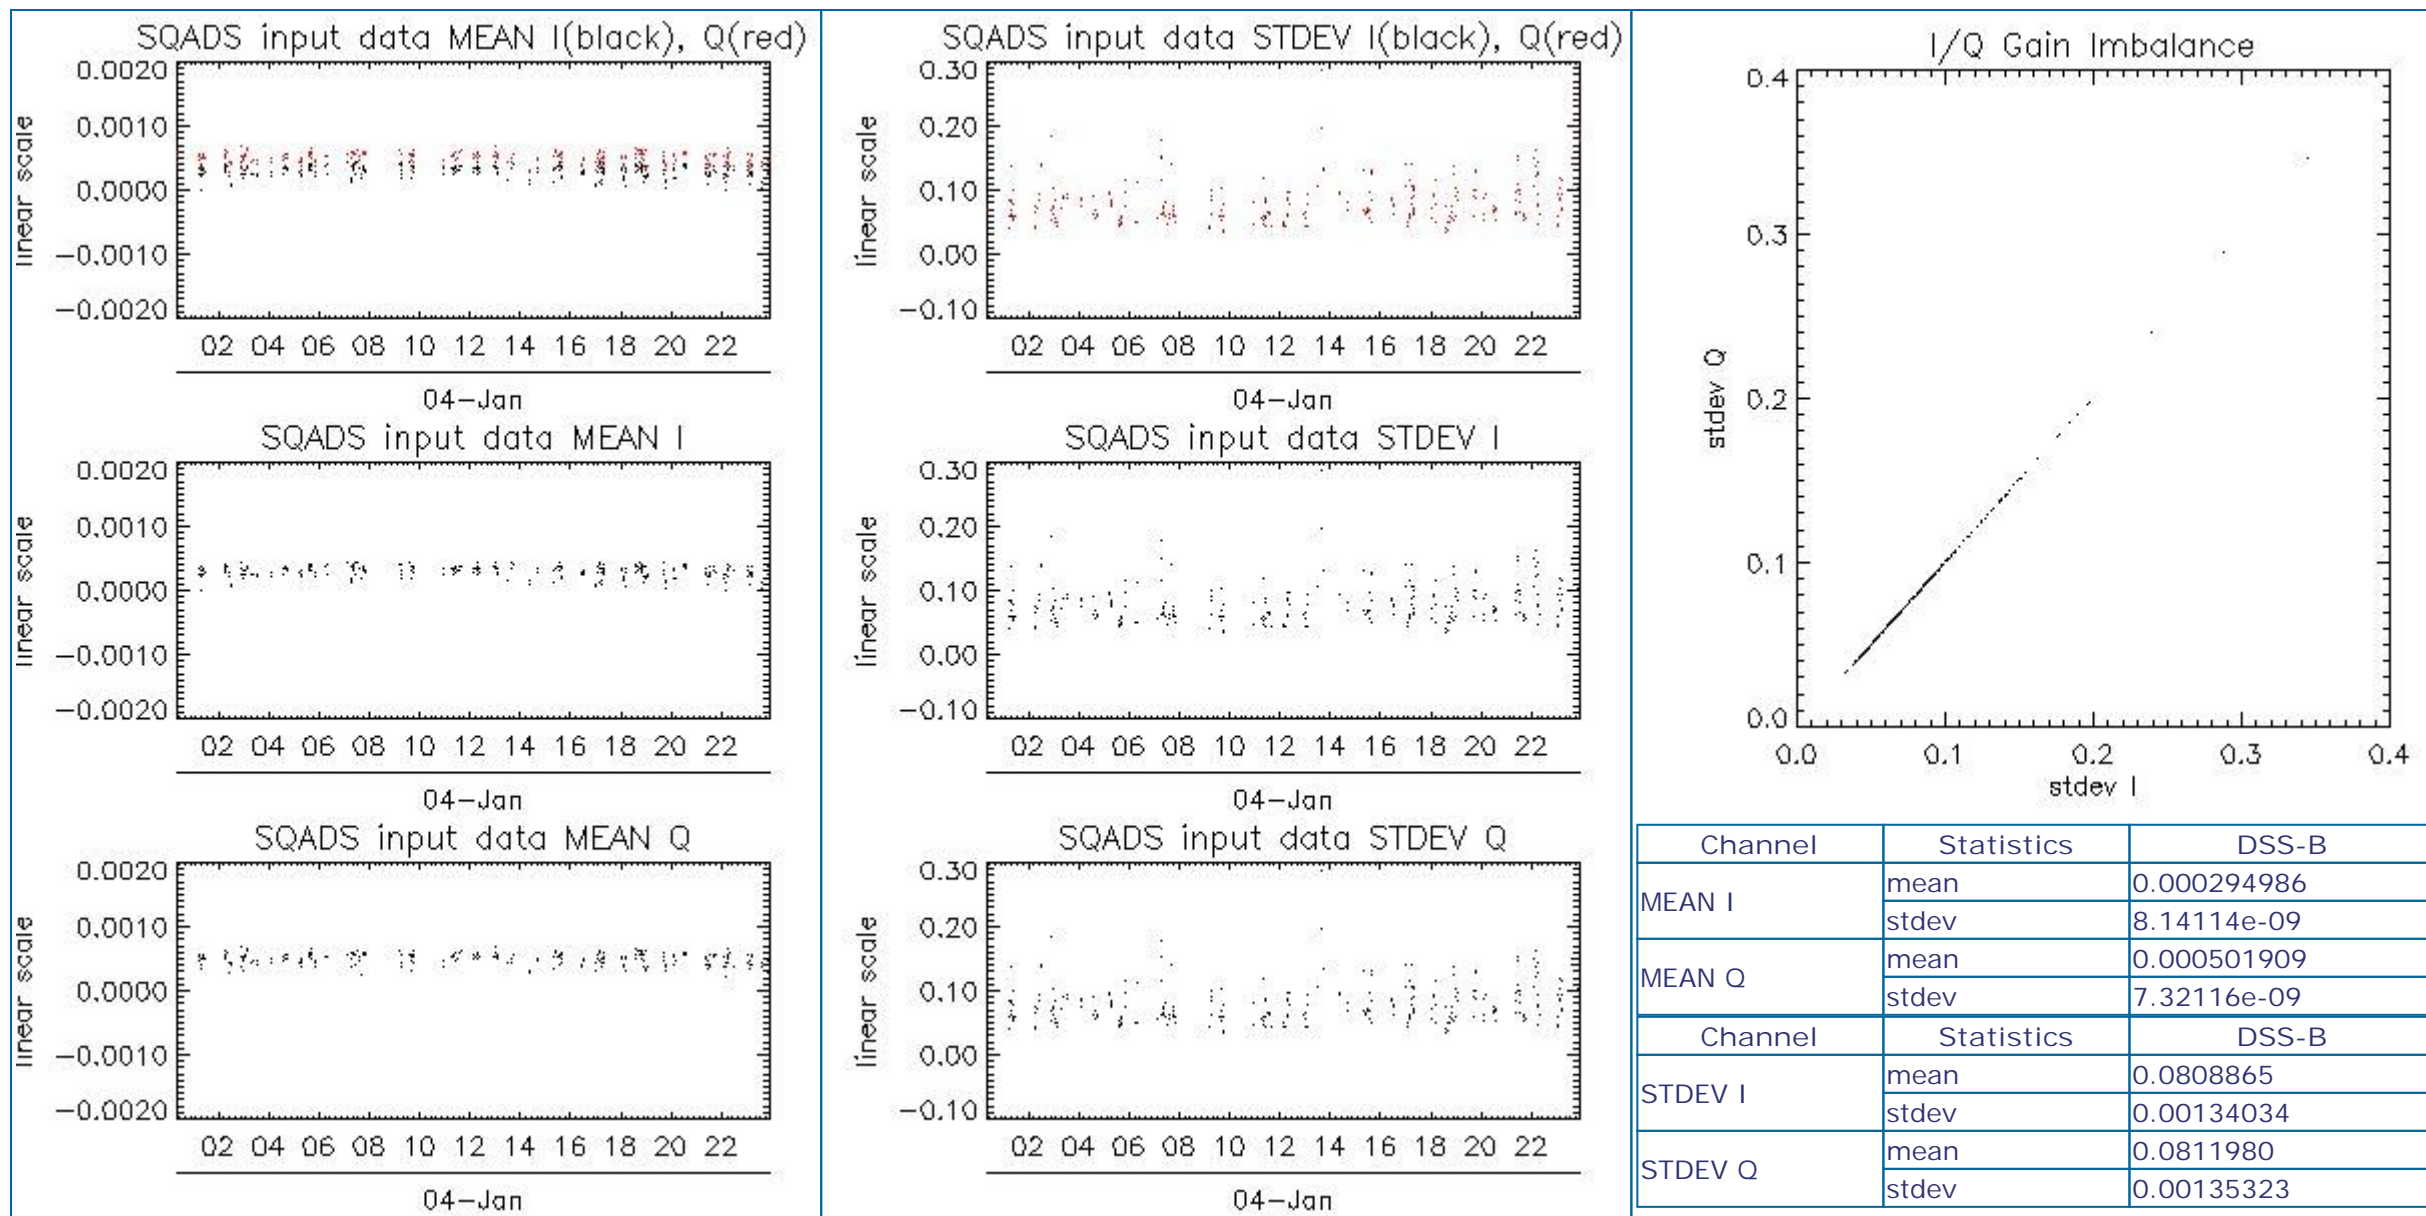



8 - TELEMETRY ANALYSIS

Processing Center	Product	Gaps	Missing lines
PDK	ASA_GM1_1PNPDK20080104_102628_000005432064_00452_30566_7440.N1	0	15
PDK	ASA_IMM_1PNPDK20080104_132910_000000352064_00453_30567_7786.N1	1	0
PDE	ASA_WSM_1PNPDE20080104_033205_000001472064_00448_30562_3574.N1	0	34
PDE	ASA_WSM_1PNPDE20080104_183638_000000852064_00457_30571_4112.N1	0	65

8.1 - Number of Missing lines


[BACK TO MENU]



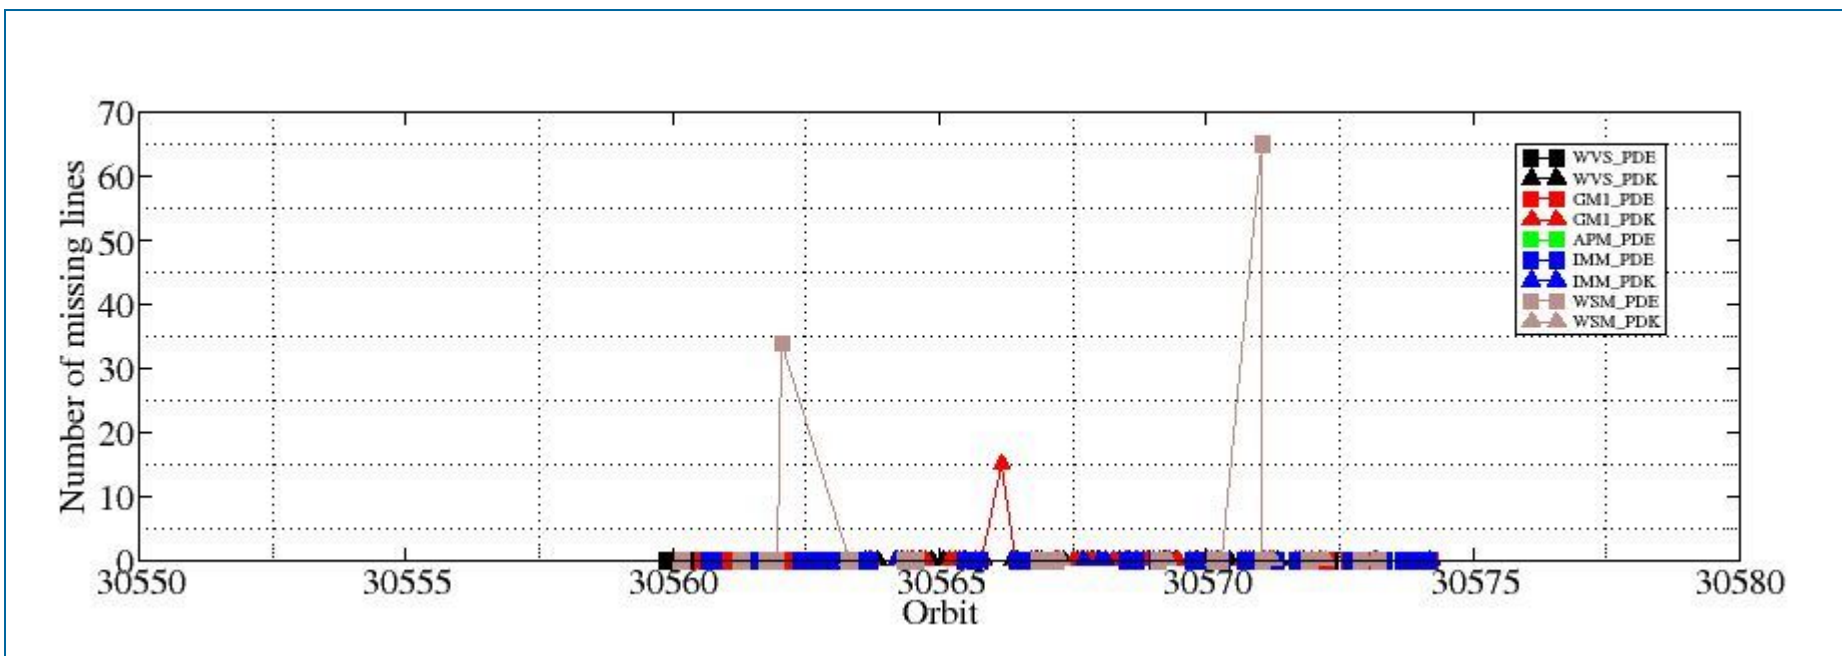

8.2 - Number of Gaps

[\[BACK TO MENU \]](#)

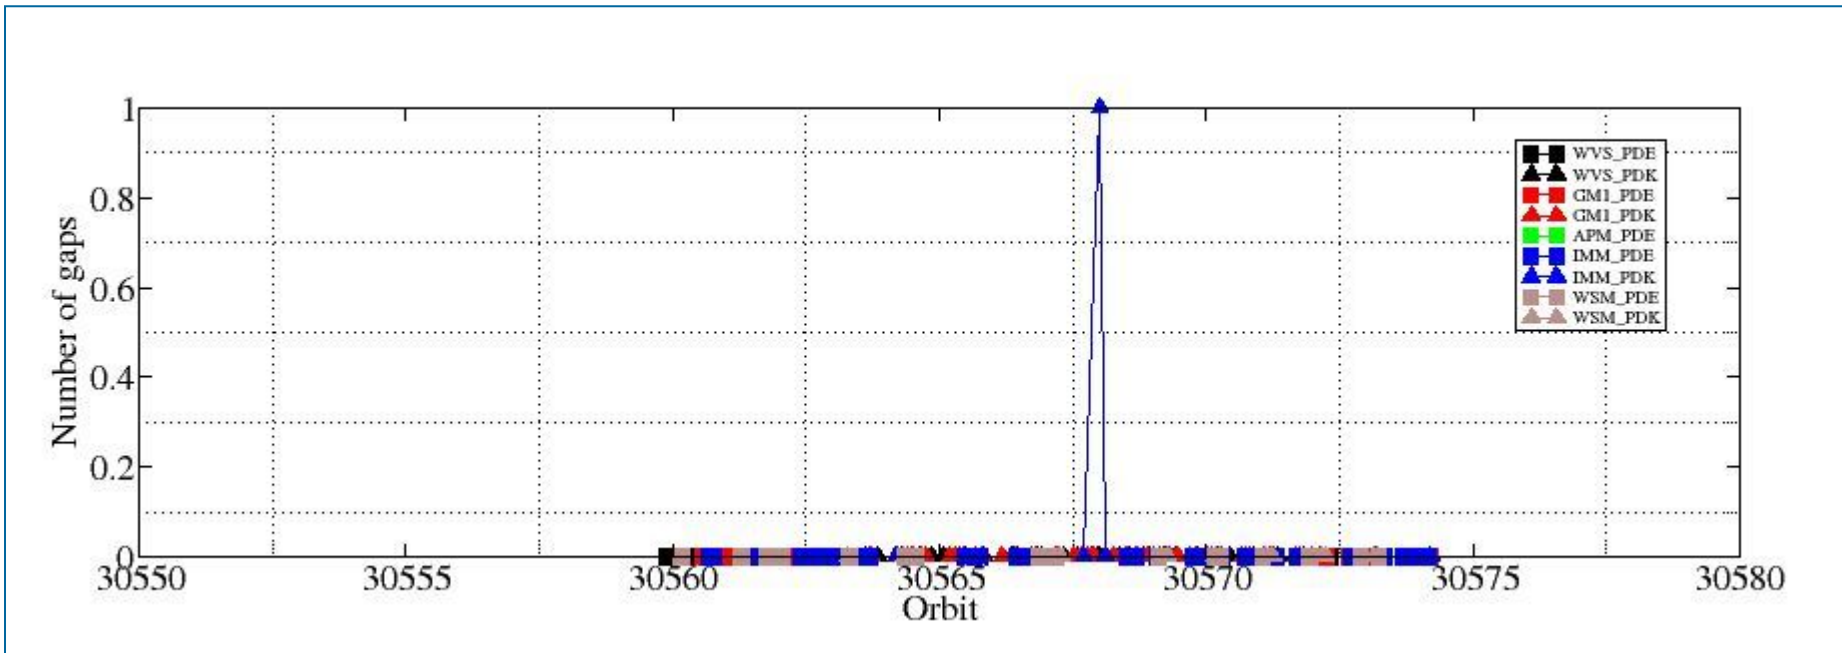

ASAR DAILY REPORT for 080104
#####

MODE: DAILY
ANALYSIS: ALL
DATE: YESTERDAY

Analysis will be performed from 2008-01-04 00:00:00 to 2008-01-04 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/080104/

DATA SUMMARY

Summary will be performed from 2008-01-04 00:00:00 to 2008-01-04 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/080104/DATA_SUMMARY

Creating directory ./RESULTS/DAILY/080104/DATA_SUMMARY...
Writing file ./RESULTS/DAILY/080104/DATA_SUMMARY/Data_summary.html...

Getting WVS products list from 2008-01-04 00:00:00 to 2008-01-04 23:59:59...
Writing file ./RESULTS/DAILY/080104/DATA_SUMMARY/List_WVS_products_used.xls...
Writing file ./RESULTS/DAILY/080104/DATA_SUMMARY/List_WVS_products_used.txt...

Getting GM1 products list from 2008-01-04 00:00:00 to 2008-01-04 23:59:59...
Writing file ./RESULTS/DAILY/080104/DATA_SUMMARY/List_GM1_products_used.xls...
Writing file ./RESULTS/DAILY/080104/DATA_SUMMARY/List_GM1_products_used.txt...

Getting APM products list from 2008-01-04 00:00:00 to 2008-01-04 23:59:59...
Writing file ./RESULTS/DAILY/080104/DATA_SUMMARY/List_APM_products_used.xls...
Writing file ./RESULTS/DAILY/080104/DATA_SUMMARY/List_APM_products_used.txt...

Getting IMM products list from 2008-01-04 00:00:00 to 2008-01-04 23:59:59...
Writing file ./RESULTS/DAILY/080104/DATA_SUMMARY/List_IMM_products_used.xls...
Writing file ./RESULTS/DAILY/080104/DATA_SUMMARY/List_IMM_products_used.txt...

Getting WSM products list from 2008-01-04 00:00:00 to 2008-01-04 23:59:59...
Writing file ./RESULTS/DAILY/080104/DATA_SUMMARY/List_WSM_products_used.xls...
Writing file ./RESULTS/DAILY/080104/DATA_SUMMARY/List_WSM_products_used.txt...

Getting MS products list from 2008-01-04 00:00:00 to 2008-01-04 23:59:59...
Writing file ./RESULTS/DAILY/080104/DATA_SUMMARY/List_MS_products_used.xls...
Writing file ./RESULTS/DAILY/080104/DATA_SUMMARY/List_MS_products_used.txt...

DATA SUMMARY completed
#####

AUXILIARY FILES ANALYSIS

Analysis will be performed from 2008-01-04 00:00:00 to 2008-01-04 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/080104/AUXILIARY

Creating directory ./RESULTS/DAILY/080104/AUXILIARY...

Looking for the IECF operational ADFs list...



Found list 20080104_030001_current_3_IECF_ADFs.txt...
Extracting ADFs...

ASA_CON_AXVIEC20071218_084201_20070204_165113_20081231_000000
ASA_INS_AXVIEC20071218_083603_20070307_060000_20081231_000000
ASA_XCH_AXVIEC20051219_162547_20020301_000000_20081231_000000
ASA_XCA_AXVIEC20071218_082742_20070204_165113_20081231_000000

Writing file ./RESULTS/DAILY/080104/AUXILIARY/ASAR_ADFs_IECF_List3.html...
Writing file ./RESULTS/DAILY/080104/AUXILIARY/Auxiliary_files_summary.html...

Analysing WVS products...

Writing file ./RESULTS/DAILY/080104/AUXILIARY/Check_ADFs_WVS.xls...
Writing file ./RESULTS/DAILY/080104/AUXILIARY/Check_ADFs_WVS.txt...

ASA_WVS_1PNPDE20080104_003959_000011412064_00446_30560_3198.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_010617_000003902064_00446_30560_3195.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_012930_000001952064_00446_30560_3205.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_013200_000003902064_00446_30560_3335.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_014810_000006142064_00447_30561_3342.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_023508_000007942064_00447_30561_3354.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_024807_000003152064_00447_30561_3473.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_030956_000002102064_00447_30561_3482.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_033012_000000592064_00448_30562_3511.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_041236_000009592064_00448_30562_3522.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_042821_000001052064_00448_30562_3646.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_043236_000000752064_00448_30562_3653.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_045041_000013342064_00448_30562_3696.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_055211_000010192064_00449_30563_3767.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_204719_000019492064_00458_30572_4135.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_213641_000002702064_00458_30572_4145.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_214026_000000452064_00458_30572_4274.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_214522_000005092064_00458_30572_4277.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_220953_000000752064_00459_30573_4280.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_222825_000019192064_00459_30573_4287.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_231717_000003452064_00459_30573_4290.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_232217_000008992064_00459_30573_4422.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080104_233925_000007042064_00460_30574_4427.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_060856_000003302064_00449_30563_7212.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_063118_000019642064_00449_30563_7228.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_075100_000002402064_00450_30564_7298.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_081153_000012742064_00450_30564_7301.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_083455_000006742064_00451_30565_7308.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_091847_000010192064_00451_30565_7431.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_095229_000019942064_00451_30565_7448.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_104352_000000742064_00452_30566_7550.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_104931_000000892064_00452_30566_7553.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_105655_000011692064_00452_30566_7560.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_113305_000001202064_00452_30566_7563.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_113858_000015742064_00452_30566_7572.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_122338_000010042064_00453_30567_7683.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_125042_000003752064_00453_30567_7693.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_131341_000003002064_00453_30567_7706.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_132720_000000742064_00453_30567_7701.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_132952_000005792064_00453_30567_7711.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_140749_000005842064_00454_30568_7826.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_142613_000006752064_00454_30568_7835.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_145417_000003752064_00454_30568_7845.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_150424_000005092064_00454_30568_7852.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_155340_000000742064_00455_30569_7966.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_155754_000012142064_00455_30569_7975.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_163453_000011092064_00455_30569_7989.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_173429_000014542064_00456_30570_8105.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080104_181932_000009742064_00456_30570_8117.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK



ASA_WVS_1PNPDK20080104_190757_000018742064_00457_30571_8236.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_WVS_1PNPDK20080104_195605_000005402064_00457_30571_8243.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing GM1 products...

Writing file ./RESULTS/DAILY/080104/AUXILIARY/Check_ADFs_GM1.xls...

Writing file ./RESULTS/DAILY/080104/AUXILIARY/Check_ADFs_GM1.txt...

ASA_GM1_1PNPDE20080104_002457_000009002064_00446_30560_3200.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_005953_000003802064_00446_30560_3202.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_012740_000001082064_00446_30560_3207.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_013912_000005372064_00446_30560_3337.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_015917_000008942064_00447_30561_3344.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_022028_000002952064_00447_30561_3339.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_022702_000001992064_00447_30561_3351.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_030236_000000842064_00447_30561_3470.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_030542_000001442064_00447_30561_3477.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_031415_000001812064_00447_30561_3475.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_031811_000001502064_00447_30561_3479.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_032400_000003622064_00447_30561_3484.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_033440_000009242064_00448_30562_3513.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_033440_000018252064_00448_30562_3612.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_033440_000018612064_00448_30562_3623.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_040505_000000362064_00448_30562_3517.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_040900_000002112064_00448_30562_3519.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_043443_000000662064_00448_30562_3648.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_044028_000001442064_00448_30562_3650.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_044428_000003682064_00448_30562_3655.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_051349_000000662064_00449_30563_3667.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_052003_000009182064_00449_30563_3693.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_054326_000003562064_00449_30563_3728.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_203058_000002352064_00458_30572_4126.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_203752_000005672064_00458_30572_4128.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_212042_000001142064_00458_30572_4132.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_212617_000000842064_00458_30572_4130.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_213443_000001142064_00458_30572_4142.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_215446_000006702064_00459_30573_4282.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_221857_000004532064_00459_30573_4284.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_231442_000001502064_00459_30573_4292.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_235320_000000842064_00460_30574_4424.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20080104_235620_000008032064_00460_30574_4429.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_061519_000001082064_00449_30563_7209.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_061945_000006882064_00449_30563_7214.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_070455_000001632064_00450_30564_7218.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_070900_000004412064_00450_30564_7225.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_072712_000004102064_00450_30564_7289.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_073555_000001872064_00450_30564_7291.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_073957_000002472064_00450_30564_7293.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_075555_000001142064_00450_30564_7295.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_080254_000005372064_00450_30564_7303.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_084705_000005012064_00451_30565_7305.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_085705_000000842064_00451_30565_7319.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_085728_000002772064_00451_30565_7422.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_090448_000000962064_00451_30565_7424.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_091306_000000722064_00451_30565_7426.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_093631_000000962064_00451_30565_7428.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_094748_000002772064_00451_30565_7433.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_102628_000005432064_00452_30566_7440.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_105145_000001992064_00452_30566_7555.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_112242_000001442064_00452_30566_7557.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_113003_000001812064_00452_30566_7565.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_120608_000002112064_00453_30567_7567.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_121258_000002112064_00453_30567_7569.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_124111_000005672064_00453_30567_7680.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20080104_125743_000000722064_00453_30567_7685.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

ASA_GM1_1PNPDK20080104_130632_000004282064_00453_30567_7703.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_131935_000004652064_00453_30567_7708.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_134233_000008332064_00454_30568_7713.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_135522_000006942064_00454_30568_7823.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_141817_000002772064_00454_30568_7828.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_142426_000001022064_00454_30568_7830.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_143935_000000782064_00454_30568_7832.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_144230_000007062064_00454_30568_7847.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_150115_000001872064_00454_30568_7842.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_151349_000003382064_00455_30569_7849.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_152354_000003682064_00455_30569_7854.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_153542_000000782064_00455_30569_7963.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_154051_000007672064_00455_30569_7968.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_155549_000001262064_00455_30569_7970.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_161855_000005132064_00455_30569_7972.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_163204_000001692064_00455_30569_7977.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_165411_000003742064_00456_30570_7979.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_170238_000001872064_00456_30570_7986.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_172151_000007552064_00456_30570_8100.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_175931_000001872064_00456_30570_8098.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_180715_000000842064_00456_30570_8102.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_181215_000001932064_00456_30570_8107.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_184012_000003082064_00457_30571_8114.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_185208_000001142064_00457_30571_8229.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_190022_000003142064_00457_30571_8231.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_194007_000001572064_00457_30571_8233.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_194920_000004042064_00457_30571_8238.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_200926_000007252064_00457_30571_8240.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080104_202530_000001442064_00458_30572_8250.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing APM products...

Writing file ./RESULTS/DAILY/080104/AUXILIARY/Check_ADFs_APM.xls...
Writing file ./RESULTS/DAILY/080104/AUXILIARY/Check_ADFs_APM.txt...

ASA_APM_1PNPDE20080104_051456_000000402064_00449_30563_3643.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20080104_073402_000000872064_00450_30564_3813.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing IMM products...

Writing file ./RESULTS/DAILY/080104/AUXILIARY/Check_ADFs_IMM.xls...
Writing file ./RESULTS/DAILY/080104/AUXILIARY/Check_ADFs_IMM.txt...

ASA_IMM_1PNPDE20080104_011416_000003012064_00446_30560_3320.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_011416_000005602064_00446_30560_3598.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_012018_000000592064_00446_30560_3309.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_012218_000000782064_00446_30560_3321.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_012416_000001872064_00446_30560_3295.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_022524_000000812064_00447_30561_3403.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_023054_000000822064_00447_30561_3596.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_023157_000000192064_00447_30561_3326.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_025459_000004392064_00447_30561_3602.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_025700_000003192064_00447_30561_3442.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_031719_000000362064_00447_30561_3450.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_040544_000000622064_00448_30562_3464.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_040544_000001802064_00448_30562_3610.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_040745_000000592064_00448_30562_3468.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_043551_000002602064_00448_30562_3592.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_044251_000000802064_00448_30562_3700.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_051610_000002152064_00449_30563_3777.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_054920_000001372064_00449_30563_3698.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_061708_000001402064_00449_30563_3783.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

ASA_IMM_1PNPDE20080104_061810_000000782064_00449_30563_3775.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_072620_000000352064_00450_30564_3803.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_073904_000000352064_00450_30564_3809.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_091418_000002632064_00451_30565_3857.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_093811_000003012064_00451_30565_3914.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_093811_000005602064_00451_30565_3918.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_094512_000001392064_00451_30565_3915.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_105506_000000982064_00452_30566_3878.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_111805_000002602064_00452_30566_3912.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_112505_000002812064_00452_30566_3946.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_142254_000000752064_00454_30568_4012.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_144052_000000802064_00454_30568_4008.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_151927_000000352064_00455_30569_3996.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_162726_000000622064_00455_30569_3998.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_162726_000002602064_00455_30569_4024.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_162928_000001372064_00455_30569_4010.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_170025_000001152064_00456_30570_4036.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_172057_000000382064_00456_30570_4044.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_180237_000002602064_00456_30570_4072.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_180837_000001992064_00456_30570_4054.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_185813_000001122064_00457_30571_4078.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_190536_000001062064_00457_30571_4092.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_194242_000002602064_00457_30571_4114.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_194742_000000802064_00457_30571_4120.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_194844_000000182064_00457_30571_4082.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_212239_000001992064_00458_30572_4244.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_212739_000001212064_00458_30572_4249.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_212739_000004052064_00458_30572_4263.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_213041_000000592064_00458_30572_4228.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_213241_000001032064_00458_30572_4250.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_222742_000000362064_00459_30573_4366.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_230222_000001812064_00459_30573_4396.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_230222_000001992064_00459_30573_4411.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_230622_000000622064_00459_30573_4380.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_230622_000004802064_00459_30573_4413.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_230823_000003602064_00459_30573_4406.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_233754_000000852064_00460_30574_4530.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080104_235142_000000802064_00460_30574_4532.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080104_070739_000000622064_00450_30564_7216.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080104_071622_000001572064_00450_30564_7272.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080104_125854_000004412064_00453_30567_7812.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080104_132910_000000352064_00453_30567_7786.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080104_134010_000001252064_00454_30568_7794.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080104_153003_000001402064_00455_30569_7937.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080104_153334_000001102064_00455_30569_7947.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080104_171124_000002622064_00456_30570_8079.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080104_185401_000001122064_00457_30571_8193.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080104_220809_000000982064_00459_30573_8370.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080104_221142_000000662064_00459_30573_8368.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080104_235442_000000812064_00460_30574_8388.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing WSM products...

Writing file ./RESULTS/DAILY/080104/AUXILIARY/Check_ADFs_WSM.xls...

Writing file ./RESULTS/DAILY/080104/AUXILIARY/Check_ADFs_WSM.txt...

ASA_WSM_1PNPDE20080104_002157_000000672064_00446_30560_3289.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_002157_000001712064_00446_30560_3614.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_002406_000000422064_00446_30560_3293.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_021423_000000672064_00447_30561_3405.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_021423_000003542064_00447_30561_3621.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_021632_000002252064_00447_30561_3448.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_030408_000000852064_00447_30561_3619.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_030515_000000182064_00447_30561_3446.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_030818_000000852064_00447_30561_3524.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

ASA_WSM_1PNPDE20080104_032234_000000672064_00447_30561_3456.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_033205_000001472064_00448_30562_3574.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_053845_000001282064_00449_30563_3779.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_053845_000002692064_00449_30563_3788.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_054148_000000862064_00449_30563_3780.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_072342_000001282064_00450_30564_3815.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_074412_000003672064_00450_30564_3836.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_074412_000004092064_00450_30564_3839.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_113558_000000672064_00452_30566_3940.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_113558_000001772064_00452_30566_3948.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_113807_000000482064_00452_30566_3944.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_120950_000001762064_00453_30567_3928.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_152119_000001472064_00455_30569_4038.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_170553_000001282064_00456_30570_4042.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_170553_000001402064_00456_30570_4118.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_171908_000000852064_00456_30570_4040.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_183638_000000852064_00457_30571_4112.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_183733_000000672064_00457_30571_4066.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_183733_000001472064_00457_30571_4124.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_183942_000000182064_00457_30571_4070.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_200552_000002012064_00457_30571_4122.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_200659_000001332064_00457_30571_4116.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_214159_000002012064_00458_30572_4265.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080104_221715_000000912064_00459_30573_4404.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20080104_053533_000002322064_00449_30563_7207.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20080104_071946_000002752064_00450_30564_7287.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20080104_121640_000004222064_00453_30567_7672.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20080104_153710_000002142064_00455_30569_7961.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20080104_170748_000001472064_00456_30570_8091.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20080104_171706_000001582064_00456_30570_8096.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20080104_184533_000003852064_00457_30571_8227.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20080104_185626_000000852064_00457_30571_8225.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20080104_202803_000001642064_00458_30572_8345.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20080104_203503_000001582064_00458_30572_8356.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20080104_220739_000000242064_00459_30573_8358.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20080104_221317_000000672064_00459_30573_8372.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20080104_221317_000002792064_00459_30573_8390.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20080104_221525_000001512064_00459_30573_8382.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

AUXILIARY FILES ANALYSIS completed

#####

MODULE STEPPING ANALYSIS

#####

Analysis will be performed from 2008-01-04 00:00:00 to 2008-01-04 23:59:59

Results will be exported to the directory: ./RESULTS/DAILY/080104/MODULE_STEPPING

Creating directory ./RESULTS/DAILY/080104/MODULE_STEPPING...

Creating directory ./RESULTS/DAILY/080104/MODULE_STEPPING/FIRST_REFERENCE...

Creating directory ./RESULTS/DAILY/080104/MODULE_STEPPING/SECOND_REFERENCE...

Creating directory ./RESULTS/DAILY/080104/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Deleting old files...

Creating images comparing with second reference...

Exporting results to the directory ../RESULTS/DAILY/080104/MODULE_STEPPING/SECOND_REFERENCE...

Polarization: H

Reference product: ASA_MS_0PNPDK20050922_062651_00000152041_00034_18625_0041.N1

Test product: ASA_MS_0PNPDK20080104_143811_00000162064_00454_30568_0449.N1

H

H



../../../../RESULTS/DAILY/080104/MODULE_STEPPING/SECOND_REFERENCE/TGH_20080104_143811-20050922_062651.png
 ../../RESULTS/DAILY/080104/MODULE_STEPPING/SECOND_REFERENCE/TPH_20080104_143811-20050922_062651.png
 ../../RESULTS/DAILY/080104/MODULE_STEPPING/SECOND_REFERENCE/RGH_20080104_143811-20050922_062651.png
 ../../RESULTS/DAILY/080104/MODULE_STEPPING/SECOND_REFERENCE/RPH_20080104_143811-20050922_062651.png

Polarization: V
 Reference product: ASA_MS__0PNPDK20050923_055514_000000152041_00048_18639_0042.N1
 Test product: ASA_MS__0PNPDK20080103_100800_000000162064_00437_30551_0448.N1

V
 V
 ../../RESULTS/DAILY/080104/MODULE_STEPPING/SECOND_REFERENCE/TGV_20080103_100800-20050923_055514.png
 ../../RESULTS/DAILY/080104/MODULE_STEPPING/SECOND_REFERENCE/TPV_20080103_100800-20050923_055514.png
 ../../RESULTS/DAILY/080104/MODULE_STEPPING/SECOND_REFERENCE/RGV_20080103_100800-20050923_055514.png
 ../../RESULTS/DAILY/080104/MODULE_STEPPING/SECOND_REFERENCE/RPV_20080103_100800-20050923_055514.png

Creating images comparing with previous product reference...

Exporting results to the directory ../../RESULTS/DAILY/080104/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Polarization: H
 Reference product: ASA_MS__0PNPDK20080102_071825_000000162064_00421_30535_0447.N1
 Test product: ASA_MS__0PNPDK20080104_143811_000000162064_00454_30568_0449.N1

H
 H
 ../../RESULTS/DAILY/080104/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGH_20080104_143811-20080102_071825.png
 ../../RESULTS/DAILY/080104/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPH_20080104_143811-20080102_071825.png
 ../../RESULTS/DAILY/080104/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGH_20080104_143811-20080102_071825.png
 ../../RESULTS/DAILY/080104/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPH_20080104_143811-20080102_071825.png

Polarization: V
 Reference product: ASA_MS__0PNPDE20080101_042850_000000162064_00405_30519_0253.N1
 Test product: ASA_MS__0PNPDK20080103_100800_000000162064_00437_30551_0448.N1

V
 V
 ../../RESULTS/DAILY/080104/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGV_20080103_100800-20080101_042850.png
 ../../RESULTS/DAILY/080104/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPV_20080103_100800-20080101_042850.png
 ../../RESULTS/DAILY/080104/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGV_20080103_100800-20080101_042850.png
 ../../RESULTS/DAILY/080104/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPV_20080103_100800-20080101_042850.png

MODULE_STEPPING ANALYSIS completed
 #####

CALIBRATION PULSES ANALYSIS
 #####

Creating directory ./RESULTS/DAILY/080104/CALIBRATION_PULSES...

ALL ROWS Analysis will be performed from 2008-01-04 00:00:00 to 2008-01-04 23:59:59

Analysing products WVS IS2 V/V
 Writing image ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Calibration_pulses_all_rows_WVS_IS2_VV.png...
 Analysing products GM1 SS3 H/H
 Writing image ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Calibration_pulses_all_rows_GM1_SS3_HH.png...

TEMPORAL EVOLUTION Analysis will be performed from 2008-01-04 00:00:00 to 2008-01-04 23:59:59

Analysing products WVS IS2 V/V
 Getting calibration pulses data for WVS IS2 V/V from 2008-01-04 00:00:00 to 2008-01-04 23:59:59. Rows: 1/5/9/13/17/21/25/29



Writing file ./RESULTS/DAILY/080104/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2008-01-04_1.dat...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_1.png...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2008-01-04 00:00:00 to 2008-01-04 23:59:59. Rows: 2/6/10/14/18/22/26/30
 Writing file ./RESULTS/DAILY/080104/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2008-01-04_2.dat...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_2.png...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2008-01-04 00:00:00 to 2008-01-04 23:59:59. Rows: 3/7/11/15/19/23/27/31
 Writing file ./RESULTS/DAILY/080104/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2008-01-04_3.dat...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_3.png...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2008-01-04 00:00:00 to 2008-01-04 23:59:59. Rows: 4/8/12/16/20/24/28/32
 Writing file ./RESULTS/DAILY/080104/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2008-01-04_4.dat...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_4.png...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_4.png...

Analysing products GM1 SS3 H/H
 Getting calibration pulses data for GM1 SS3 H/H from 2008-01-04 00:00:00 to 2008-01-04 23:59:59. Rows: 1/5/9/13/17/21/25/29
 Writing file ./RESULTS/DAILY/080104/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2008-01-04_1.dat...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_1.png...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_1.png...

Getting calibration pulses data for GM1 SS3 H/H from 2008-01-04 00:00:00 to 2008-01-04 23:59:59. Rows: 2/6/10/14/18/22/26/30
 Writing file ./RESULTS/DAILY/080104/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2008-01-04_2.dat...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_2.png...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2008-01-04 00:00:00 to 2008-01-04 23:59:59. Rows: 3/7/11/15/19/23/27/31
 Writing file ./RESULTS/DAILY/080104/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2008-01-04_3.dat...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_3.png...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2008-01-04 00:00:00 to 2008-01-04 23:59:59. Rows: 4/8/12/16/20/24/28/32
 Writing file ./RESULTS/DAILY/080104/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2008-01-04_4.dat...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_4.png...
 Writing ../../RESULTS/DAILY/080104//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_4.png...

CALIBRATION PULSES ANALYSIS completed
 #####

DOPPLER ANALYSIS
 #####
 Creating directory ./RESULTS/DAILY/080104/DOPPLER...

 DOPPLER ANX Analysis will be performed from 2008-01-04 00:00:00 to 2008-01-04 23:59:59

Analysing products WVS IS2 V/V
 Getting doppler data for WVS IS2 V/V from 2008-01-04 00:00:00 to 2008-01-04 23:59:59...
 Writing file ./RESULTS/DAILY/080104/DOPPLER/Doppler_data_WVS_IS2_VV_2008-01-04.dat...
 Running IDL program...

Writing file ../../RESULTS/DAILY/080104/DOPPLER/DOPPLER_ANX_WVS_IS2_VV.png...

Analysing products GM1 SS1 H/H

Getting doppler data for GM1 SS1 H/H from 2008-01-04 00:00:00 to 2008-01-04 23:59:59...

Writing file ./RESULTS/DAILY/080104/DOPPLER/Doppler_data_GM1_SS1_HH_2008-01-04.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/080104/DOPPLER/DOPPLER_ANX_GM1_SS1_HH.png...

DOPPLER JUMPS Analysis will be performed on WSM products from 2008-01-04 00:00:00 to 2008-01-04 23:59:59

Analysing by default products WSM

Getting doppler jumps data for WSM from 2008-01-04 00:00:00 to 2008-01-04 23:59:59...

Writing file ./RESULTS/DAILY/080104/DOPPLER/Doppler_Jumps_data_WSM_2008-01-04.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/080104/DOPPLER/DOPPLER_JUMPS_ANX_WSM.png...

Writing file ../../RESULTS/DAILY/080104/DOPPLER/DOPPLER_JUMPS_Date_WSM.png...

DOPPLER MAP Analysis will be performed from 2008-01-04 00:00:00 to 2008-01-04 23:59:59

Analysing products WVS IS2 V/V

Loading predicted doppler values....

Phase: descending

Found data...

Computing mean error doppler estimated-predicted...

Mean error = -14.455522 Hz

Writing file ../../RESULTS/DAILY/080104//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_desc.jpg...

Writing file ../../RESULTS/DAILY/080104//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_desc.jpg...

Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -17.008403 Hz
Writing file ../../RESULTS/DAILY/080104//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_asc.jpg...
Writing file ../../RESULTS/DAILY/080104//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_asc.jpg...

Analysing products GM1 SS1 H/H
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -13.870746 Hz
Writing file ../../RESULTS/DAILY/080104//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_desc.jpg...
Writing file ../../RESULTS/DAILY/080104//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_desc.jpg...

Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -16.392316 Hz
Writing file ../../RESULTS/DAILY/080104//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_asc.jpg...
Writing file ../../RESULTS/DAILY/080104//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_asc.jpg...

DOPPLER ANALYSIS completed

#####

CHIRP ANALYSIS

#####

Creating directory ./RESULTS/DAILY/080104/CHIRP...

CHIRP Analysis will be performed from 2008-01-04 00:00:00 to 2008-01-04 23:59:59

Analysing products WSM SS1 H/H

Getting ScaleFactor data for WSM SS1 H/H from 2008-01-04 00:00:00 to 2008-01-04 23:59:59...

Writing file ./RESULTS/DAILY/080104/CHIRP/ScaleFactor_data_WSM_SS1_HH_2008-01-04.dat...

Running IDL program...

Writing file ../RESULTS/DAILY/080104/CHIRP/ScaleFactor_ANX_WSM_SS1_HH.png...

Writing file ../RESULTS/DAILY/080104/CHIRP/ScaleFactor_DATE_WSM_SS1_HH.png...

Analysing products WSM SS1 V/V

Getting ScaleFactor data for WSM SS1 V/V from 2008-01-04 00:00:00 to 2008-01-04 23:59:59...

Writing file ./RESULTS/DAILY/080104/CHIRP/ScaleFactor_data_WSM_SS1_VV_2008-01-04.dat...

Running IDL program...

Writing file ../RESULTS/DAILY/080104/CHIRP/ScaleFactor_ANX_WSM_SS1_VV.png...

Writing file ../RESULTS/DAILY/080104/CHIRP/ScaleFactor_DATE_WSM_SS1_VV.png...

CHIRP ANALYSIS completed

#####

RAW DATA ANALYSIS

#####

Analysis will be performed from 2008-01-04 00:00:00 to 2008-01-04 23:59:59

Results will be exported to the directory: ./RESULTS/DAILY/080104/RAW_DATA

Creating directory ./RESULTS/DAILY/080104/RAW_DATA...

Getting raw data for WVS from 2008-01-04 00:00:00 to 2008-01-04 23:59:59...

Writing file ./RESULTS/DAILY/080104/RAW_DATA/Raw_data_WVS_2008-01-04.dat...

Running IDL program to create graphs...

Creating image ../RESULTS/DAILY/080104/RAW_DATA/Raw_data_WVS_input_mean.png...

Creating image ../RESULTS/DAILY/080104/RAW_DATA/Raw_data_WVS_input_stdev.png...

Creating image ../RESULTS/DAILY/080104/RAW_DATA/Raw_data_WVS_gain_imbalance.png...

Getting raw data for IMM from 2008-01-04 00:00:00 to 2008-01-04 23:59:59...

Writing file ./RESULTS/DAILY/080104/RAW_DATA/Raw_data_IMM_2008-01-04.dat...

Running IDL program to create graphs...

Creating image ../RESULTS/DAILY/080104/RAW_DATA/Raw_data_IMM_input_mean.png...

Creating image ../RESULTS/DAILY/080104/RAW_DATA/Raw_data_IMM_input_stdev.png...

Creating image ../RESULTS/DAILY/080104/RAW_DATA/Raw_data_IMM_gain_imbalance.png...

RAW DATA ANALYSIS completed

#####

TELEMETRY ANALYSIS

Analysis will be performed from 2008-01-04 00:00:00 to 2008-01-04 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/080104/TELEMETRY

Creating directory ./RESULTS/DAILY/080104/TELEMETRY...

Looking for gaps and missing lines in WVS products...

Checking 24 products from PDE...
Checking 28 products from PDK...

Looking for gaps and missing lines in GM1 products...

Checking 33 products from PDE...
Checking 53 products from PDK...
Found product...ASA_GM1_1PNPDK20080104_102628_000005432064_00452_30566_7440.N1 / 0 gaps / 15 missing lines

Looking for gaps and missing lines in APM products...

Checking 2 products from PDE...
No products from PDK...

Looking for gaps and missing lines in IMM products...

Checking 57 products from PDE...
Checking 12 products from PDK...
Found product...ASA_IMM_1PNPDK20080104_132910_00000352064_00453_30567_7786.N1 / 1 gaps / 0 missing lines

Looking for gaps and missing lines in WSM products...

Checking 33 products from PDE...
Found product...ASA_WSM_1PNPDE20080104_033205_000001472064_00448_30562_3574.N1 / 0 gaps / 34 missing lines
Found product...ASA_WSM_1PNPDE20080104_183638_000000852064_00457_30571_4112.N1 / 0 gaps / 65 missing lines
Checking 14 products from PDK...

Creating graph of missing lines and gaps...

Creating image: ./RESULTS/DAILY/080104/TELEMETRY/TELEMETRY_Missing_lines.png...
Creating image: ./RESULTS/DAILY/080104/TELEMETRY/TELEMETRY_Gaps.png...

TELEMETRY ANALYSIS completed

#####

BROWSE PRODUCTS ANALYSIS

#####

Analysis will be performed on 2008-01-04

Scanning directory /nas3/ENVISAT/ASAR//ASA_GM_BP...
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_GM_BP/JPG/20080104/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20080104_203058_000002352064_00458_30572_4127.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20080104_203752_000005672064_00458_30572_4129.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20080104_212042_000001142064_00458_30572_4133.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20080104_212617_000000842064_00458_30572_4131.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20080104_213443_000001142064_00458_30572_4143.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20080104_215446_000006702064_00459_30573_4283.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20080104_221857_000004532064_00459_30573_4285.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20080104_231442_000001502064_00459_30573_4293.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20080104_235320_000000842064_00460_30574_4425.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20080104_235620_000008032064_00460_30574_4430.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDK20080104_185208_000001142064_00457_30571_8230.N1 ...

```
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDK20080104_190022_000003142064_00457_30571_8232.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDK20080104_194007_000001572064_00457_30571_8234.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDK20080104_194920_000004042064_00457_30571_8239.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDK20080104_200926_000007252064_00457_30571_8241.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDK20080104_202530_000001442064_00458_30572_8251.N1 ...
```

ANALYSIS COMPLETED: 16 GM browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_AP_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_AP_BP/JPG/20080104/

ANALYSIS COMPLETED: 0 AP browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_IM_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_IM_BP/JPG/20080104/

```
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_091418_000002632064_00451_30565_3858.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_093811_000003012064_00451_30565_3916.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_093811_000005602064_00451_30565_3919.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_094512_000001392064_00451_30565_3917.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_105506_000000982064_00452_30566_3879.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_111805_000002602064_00452_30566_3913.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_112505_000002812064_00452_30566_3947.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_142254_000000752064_00454_30568_4013.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_144052_000000802064_00454_30568_4009.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_151927_000000352064_00455_30569_3997.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_162726_000000622064_00455_30569_3999.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_162726_000002602064_00455_30569_4025.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_162928_000001372064_00455_30569_4011.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_170025_000001152064_00456_30570_4037.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_172057_000000382064_00456_30570_4045.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_180237_000002602064_00456_30570_4073.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_180837_000001992064_00456_30570_4055.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_185813_000001122064_00457_30571_4079.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_190536_000001062064_00457_30571_4093.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_194242_000002602064_00457_30571_4115.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_194742_000000802064_00457_30571_4121.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_194844_000000182064_00457_30571_4083.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_212239_000001992064_00458_30572_4245.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_212739_000001212064_00458_30572_4251.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_212739_000004052064_00458_30572_4264.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_213041_000000592064_00458_30572_4229.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_213241_000001032064_00458_30572_4252.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_222742_000000362064_00459_30573_4367.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_230222_000001812064_00459_30573_4397.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_230222_000001992064_00459_30573_4412.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_230622_000000622064_00459_30573_4381.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_230622_000004802064_00459_30573_4414.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_230823_000003602064_00459_30573_4407.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_233754_000000852064_00460_30574_4531.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20080104_235142_000000802064_00460_30574_4533.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDK20080104_185401_000001122064_00457_30571_8194.N1 ...
```

ANALYSIS COMPLETED: 36 IM browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_WS_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_WS_BP/JPG/20080104/

```
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_074412_000004092064_00450_30564_3840.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_113558_000000672064_00452_30566_3941.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_113558_000001772064_00452_30566_3949.N1 ...
```

Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_113807_000000482064_00452_30566_3945.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_120950_000001762064_00453_30567_3929.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_152119_000001472064_00455_30569_4039.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_170553_000001282064_00456_30570_4043.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_170553_000001402064_00456_30570_4119.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_171908_000000852064_00456_30570_4041.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_183638_000000852064_00457_30571_4113.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_183733_000000672064_00457_30571_4067.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_183733_000001472064_00457_30571_4125.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_183942_000000182064_00457_30571_4071.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_200552_000002012064_00457_30571_4123.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_200659_000001332064_00457_30571_4117.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_214159_000002012064_00458_30572_4266.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20080104_221715_000000912064_00459_30573_4405.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDK20080104_184533_000003852064_00457_30571_8228.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDK20080104_185626_000000852064_00457_30571_8226.N1 ...

ANALYSIS COMPLETED: 19 WS browse products to see...

BROWSE PRODUCTS ANALYSIS completed

#####

HTML REPORT generation

#####

Building file ./RESULTS/DAILY/080104/asarReport.html...

Building DATA SUMMARY section...

Building AUXILIARY FILES ANALYSIS section...

Building MODULE STEPPING ANALYSIS section...

Building CALIBRATION PULSES ANALYSIS section...

Building DOPPLER ANALYSIS section...

Building CHIRP ANALYSIS section...

Building RAW DATA ANALYSIS section...

Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed

#####



ASAR Daily Report



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20080104_051456_000000402064_00449_30563_3643.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20080104_073402_000000872064_00450_30564_3813.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20080104_002457_000009002064_00446_30560_3200.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_005953_000003802064_00446_30560_3202.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_012740_000001082064_00446_30560_3207.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_013912_000005372064_00446_30560_3337.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_015917_000008942064_00447_30561_3344.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_022028_000002952064_00447_30561_3339.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_022702_000001992064_00447_30561_3351.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_030236_000000842064_00447_30561_3470.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_030542_000001442064_00447_30561_3477.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_031415_000001812064_00447_30561_3475.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_031811_000001502064_00447_30561_3479.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_032400_000003622064_00447_30561_3484.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_033440_000009242064_00448_30562_3513.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_033440_000018252064_00448_30562_3612.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_033440_000018612064_00448_30562_3623.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_040505_000000362064_00448_30562_3517.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_040900_000002112064_00448_30562_3519.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_043443_000000662064_00448_30562_3648.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_044028_000001442064_00448_30562_3650.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_044428_000003682064_00448_30562_3655.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_051349_000000662064_00449_30563_3667.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_052003_000009182064_00449_30563_3693.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_054326_000003562064_00449_30563_3728.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_203058_000002352064_00458_30572_4126.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_203752_000005672064_00458_30572_4128.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_212042_000001142064_00458_30572_4132.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_212617_000000842064_00458_30572_4130.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_213443_000001142064_00458_30572_4142.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_215446_000006702064_00459_30573_4282.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_221857_000004532064_00459_30573_4284.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_231442_000001502064_00459_30573_4292.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_235320_000000842064_00460_30574_4424.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080104_235620_000008032064_00460_30574_4429.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_061519_000001082064_00449_30563_7209.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_061945_000006882064_00449_30563_7214.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_070455_000001632064_00450_30564_7218.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_070900_000004412064_00450_30564_7225.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_072712_000004102064_00450_30564_7289.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_073555_000001872064_00450_30564_7291.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_073957_000002472064_00450_30564_7293.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_075555_000001142064_00450_30564_7295.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_080254_000005372064_00450_30564_7303.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_084705_000005012064_00451_30565_7305.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_085705_000000842064_00451_30565_7319.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_085728_000002772064_00451_30565_7422.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_090448_000000962064_00451_30565_7424.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_091306_000000722064_00451_30565_7426.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_093631_000000962064_00451_30565_7428.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_094748_000002772064_00451_30565_7433.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_102628_000005432064_00452_30566_7440.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_105145_000001992064_00452_30566_7555.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_112242_000001442064_00452_30566_7557.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_113003_000001812064_00452_30566_7565.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_120608_000002112064_00453_30567_7567.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_121258_000002112064_00453_30567_7569.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_124111_000005672064_00453_30567_7680.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_125743_000000722064_00453_30567_7685.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_130632_000004282064_00453_30567_7703.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_131935_000004652064_00453_30567_7708.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_134233_000008332064_00454_30568_7713.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_135522_000006942064_00454_30568_7823.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_141817_000002772064_00454_30568_7828.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_142426_000001022064_00454_30568_7830.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_143935_000000782064_00454_30568_7832.N1					OK	OK	OK	OK

ASA_GM1_1PNPDK20080104_144230_000007062064_00454_30568_7847.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_150115_000001872064_00454_30568_7842.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_151349_000003382064_00455_30569_7849.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_152354_000003682064_00455_30569_7854.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_153542_000000782064_00455_30569_7963.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_154051_000007672064_00455_30569_7968.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_155549_000001262064_00455_30569_7970.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_161855_000005132064_00455_30569_7972.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_163204_000001692064_00455_30569_7977.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_165411_000003742064_00456_30570_7979.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_170238_000001872064_00456_30570_7986.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_172151_000007552064_00456_30570_8100.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_175931_000001872064_00456_30570_8098.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_180715_000000842064_00456_30570_8102.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_181215_000001932064_00456_30570_8107.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_184012_000003082064_00457_30571_8114.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_185208_000001142064_00457_30571_8229.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_190022_000003142064_00457_30571_8231.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_194007_000001572064_00457_30571_8233.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_194920_000004042064_00457_30571_8238.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_200926_000007252064_00457_30571_8240.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080104_202530_000001442064_00458_30572_8250.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_IMM_1PNPDE20080104_011416_000003012064_00446_30560_3320.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_011416_000005602064_00446_30560_3598.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_012018_000000592064_00446_30560_3309.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_012218_000000782064_00446_30560_3321.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_012416_000001872064_00446_30560_3295.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_022524_000000812064_00447_30561_3403.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_023054_000000822064_00447_30561_3596.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_023157_000000192064_00447_30561_3326.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_025459_000004392064_00447_30561_3602.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_025700_000003192064_00447_30561_3442.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_031719_000000362064_00447_30561_3450.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_040544_000000622064_00448_30562_3464.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_040544_000001802064_00448_30562_3610.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_040745_000000592064_00448_30562_3468.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_043551_000002602064_00448_30562_3592.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_044251_000000802064_00448_30562_3700.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_051610_000002152064_00449_30563_3777.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_054920_000001372064_00449_30563_3698.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_061708_000001402064_00449_30563_3783.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_061810_000000782064_00449_30563_3775.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_072620_000000352064_00450_30564_3803.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_073904_000000352064_00450_30564_3809.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_091418_000002632064_00451_30565_3857.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_093811_000003012064_00451_30565_3914.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_093811_000005602064_00451_30565_3918.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_094512_000001392064_00451_30565_3915.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_105506_000000982064_00452_30566_3878.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_111805_000002602064_00452_30566_3912.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_112505_000002812064_00452_30566_3946.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_142254_000000752064_00454_30568_4012.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_144052_000000802064_00454_30568_4008.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_151927_000000352064_00455_30569_3996.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_162726_000000622064_00455_30569_3998.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_162726_000002602064_00455_30569_4024.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_162928_000001372064_00455_30569_4010.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_170025_000001152064_00456_30570_4036.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_172057_000000382064_00456_30570_4044.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_180237_000002602064_00456_30570_4072.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_180837_000001992064_00456_30570_4054.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_185813_000001122064_00457_30571_4078.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_190536_000001062064_00457_30571_4092.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_194242_000002602064_00457_30571_4114.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_194742_000000802064_00457_30571_4120.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_194844_000000182064_00457_30571_4082.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_212239_000001992064_00458_30572_4244.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_212739_000001212064_00458_30572_4249.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_212739_000004052064_00458_30572_4263.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_213041_000000592064_00458_30572_4228.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_213241_000001032064_00458_30572_4250.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_222742_000000362064_00459_30573_4366.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_230222_000001812064_00459_30573_4396.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_230222_000001992064_00459_30573_4411.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_230622_000000622064_00459_30573_4380.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_230622_000004802064_00459_30573_4413.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_230823_000003602064_00459_30573_4406.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_233754_000000852064_00460_30574_4530.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080104_235142_000000802064_00460_30574_4532.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080104_070739_000000622064_00450_30564_7216.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080104_071622_000001572064_00450_30564_7272.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080104_125854_000004412064_00453_30567_7812.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080104_132910_000000352064_00453_30567_7786.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080104_134010_000001252064_00454_30568_7794.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080104_153003_000001402064_00455_30569_7937.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080104_153334_000001102064_00455_30569_7947.N1					OK	OK	OK	OK

ASA_IMM_1PNPDK20080104_171124_000002622064_00456_30570_8079.N1	OK	OK	OK	OK
ASA_IMM_1PNPDK20080104_185401_000001122064_00457_30571_8193.N1	OK	OK	OK	OK
ASA_IMM_1PNPDK20080104_220809_000000982064_00459_30573_8370.N1	OK	OK	OK	OK
ASA_IMM_1PNPDK20080104_221142_000000662064_00459_30573_8368.N1	OK	OK	OK	OK
ASA_IMM_1PNPDK20080104_235442_000000812064_00460_30574_8388.N1	OK	OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WSM_1PNPDE20080104_002157_000000672064_00446_30560_3289.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_002157_000001712064_00446_30560_3614.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_002406_000000422064_00446_30560_3293.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_021423_000000672064_00447_30561_3405.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_021423_000003542064_00447_30561_3621.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_021632_000002252064_00447_30561_3448.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_030408_000000852064_00447_30561_3619.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_030515_000000182064_00447_30561_3446.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_030818_000000852064_00447_30561_3524.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_032234_000000672064_00447_30561_3456.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_033205_000001472064_00448_30562_3574.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_053845_000001282064_00449_30563_3779.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_053845_000002692064_00449_30563_3788.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_054148_000000862064_00449_30563_3780.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_072342_000001282064_00450_30564_3815.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_074412_000003672064_00450_30564_3836.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_074412_000004092064_00450_30564_3839.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_113558_000000672064_00452_30566_3940.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_113558_000001772064_00452_30566_3948.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_113807_000000482064_00452_30566_3944.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_120950_000001762064_00453_30567_3928.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_152119_000001472064_00455_30569_4038.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_170553_000001282064_00456_30570_4042.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_170553_000001402064_00456_30570_4118.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_171908_000000852064_00456_30570_4040.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_183638_000000852064_00457_30571_4112.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_183733_000000672064_00457_30571_4066.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_183733_000001472064_00457_30571_4124.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_183942_000000182064_00457_30571_4070.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_200552_000002012064_00457_30571_4122.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_200659_000001332064_00457_30571_4116.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_214159_000002012064_00458_30572_4265.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20080104_221715_000000912064_00459_30573_4404.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20080104_053533_000002322064_00449_30563_7207.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20080104_071946_000002752064_00450_30564_7287.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20080104_121640_000004222064_00453_30567_7672.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20080104_153710_000002142064_00455_30569_7961.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20080104_170748_000001472064_00456_30570_8091.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20080104_171706_000001582064_00456_30570_8096.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20080104_184533_000003852064_00457_30571_8227.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20080104_185626_000000852064_00457_30571_8225.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20080104_202803_000001642064_00458_30572_8345.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20080104_203503_000001582064_00458_30572_8356.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20080104_220739_000000242064_00459_30573_8358.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20080104_221317_000000672064_00459_30573_8372.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20080104_221317_000002792064_00459_30573_8390.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20080104_221525_000001512064_00459_30573_8382.N1					OK	OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20080104_003959_000011412064_00446_30560_3198.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_010617_000003902064_00446_30560_3195.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_012930_000001952064_00446_30560_3205.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_013200_000003902064_00446_30560_3335.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_014810_000006142064_00447_30561_3342.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_023508_000007942064_00447_30561_3354.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_024807_000003152064_00447_30561_3473.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_030956_000002102064_00447_30561_3482.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_033012_000000592064_00448_30562_3511.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_041236_000009592064_00448_30562_3522.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_042821_000001052064_00448_30562_3646.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_043236_000000752064_00448_30562_3653.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_045041_000013342064_00448_30562_3696.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_055211_000010192064_00449_30563_3767.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_204719_000019492064_00458_30572_4135.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_213641_000002702064_00458_30572_4145.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_214026_000000452064_00458_30572_4274.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_214522_000005092064_00458_30572_4277.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_220953_000000752064_00459_30573_4280.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_222825_000019192064_00459_30573_4287.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_231717_000003452064_00459_30573_4290.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_232217_000008992064_00459_30573_4422.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080104_233925_000007042064_00460_30574_4427.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_060856_000003302064_00449_30563_7212.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_063118_000019642064_00449_30563_7228.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_075100_000002402064_00450_30564_7298.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_081153_000012742064_00450_30564_7301.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_083455_000006742064_00451_30565_7308.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_091847_000010192064_00451_30565_7431.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_095229_000019942064_00451_30565_7448.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_104352_000000742064_00452_30566_7550.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_104931_000000892064_00452_30566_7553.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_105655_000011692064_00452_30566_7560.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_113305_000001202064_00452_30566_7563.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_113858_000015742064_00452_30566_7572.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_122338_000010042064_00453_30567_7683.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_125042_000003752064_00453_30567_7693.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_131341_000003002064_00453_30567_7706.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_132720_000000742064_00453_30567_7701.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_132952_000005792064_00453_30567_7711.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_140749_000005842064_00454_30568_7826.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_142613_000006752064_00454_30568_7835.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_145417_000003752064_00454_30568_7845.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_150424_000005092064_00454_30568_7852.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_155340_000000742064_00455_30569_7966.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_155754_000012142064_00455_30569_7975.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_163453_000011092064_00455_30569_7989.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_173429_000014542064_00456_30570_8105.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_181932_000009742064_00456_30570_8117.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_190757_000018742064_00457_30571_8236.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080104_195605_000005402064_00457_30571_8243.N1					OK	OK	OK	OK


Calibration pulses for GM1 SS3 H/H

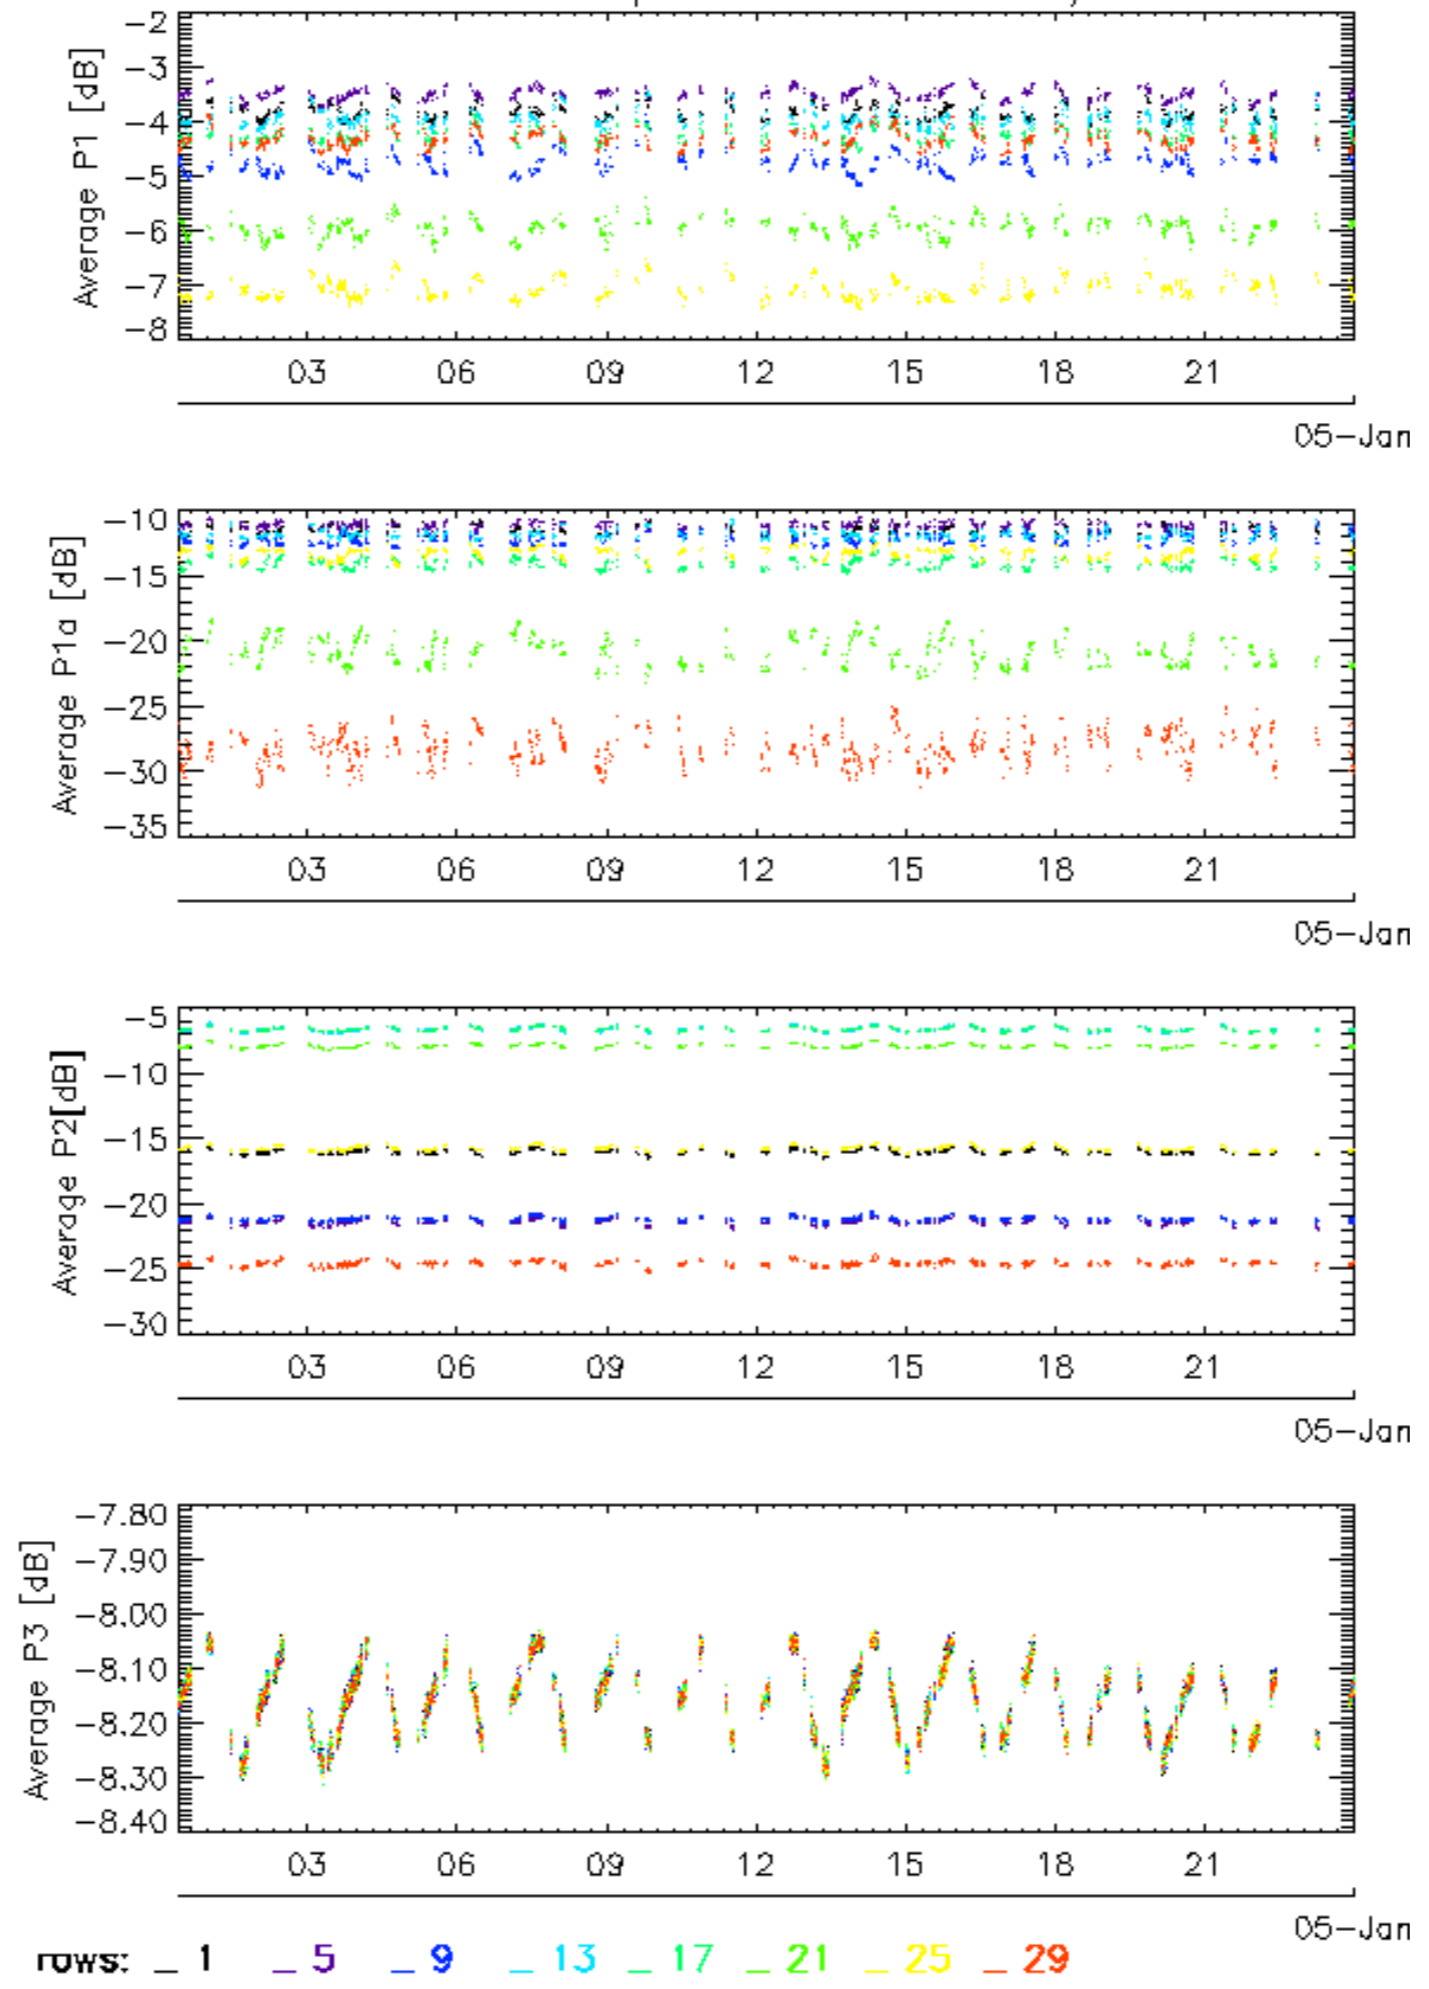


Calibration pulses for GM1 SS3 H/H

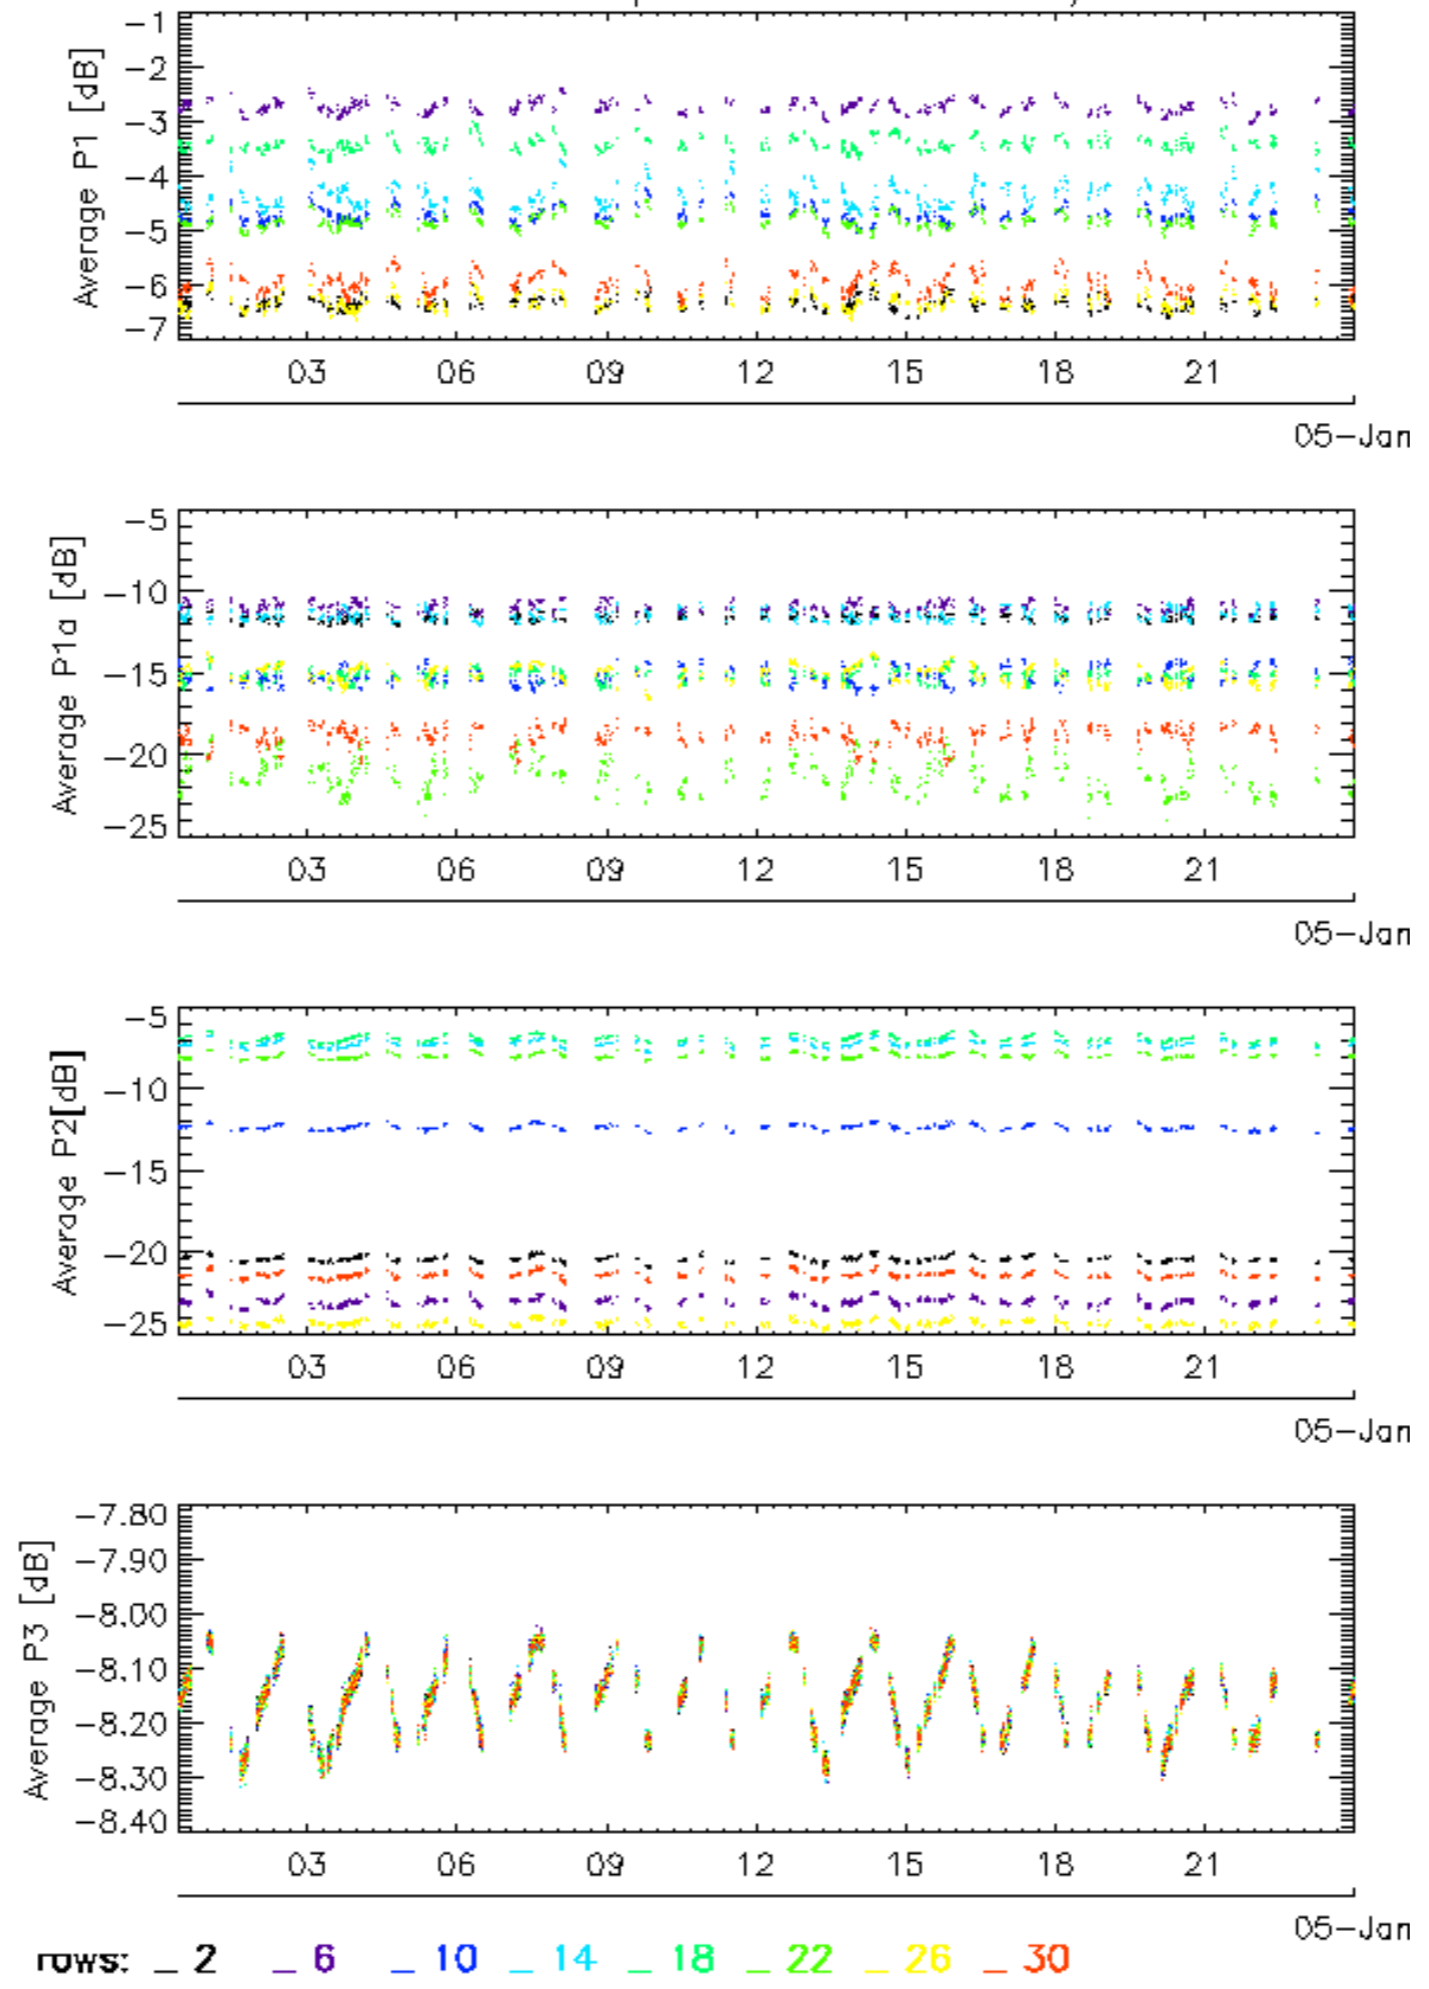


Calibration pulses for GM1 SS3 H/H

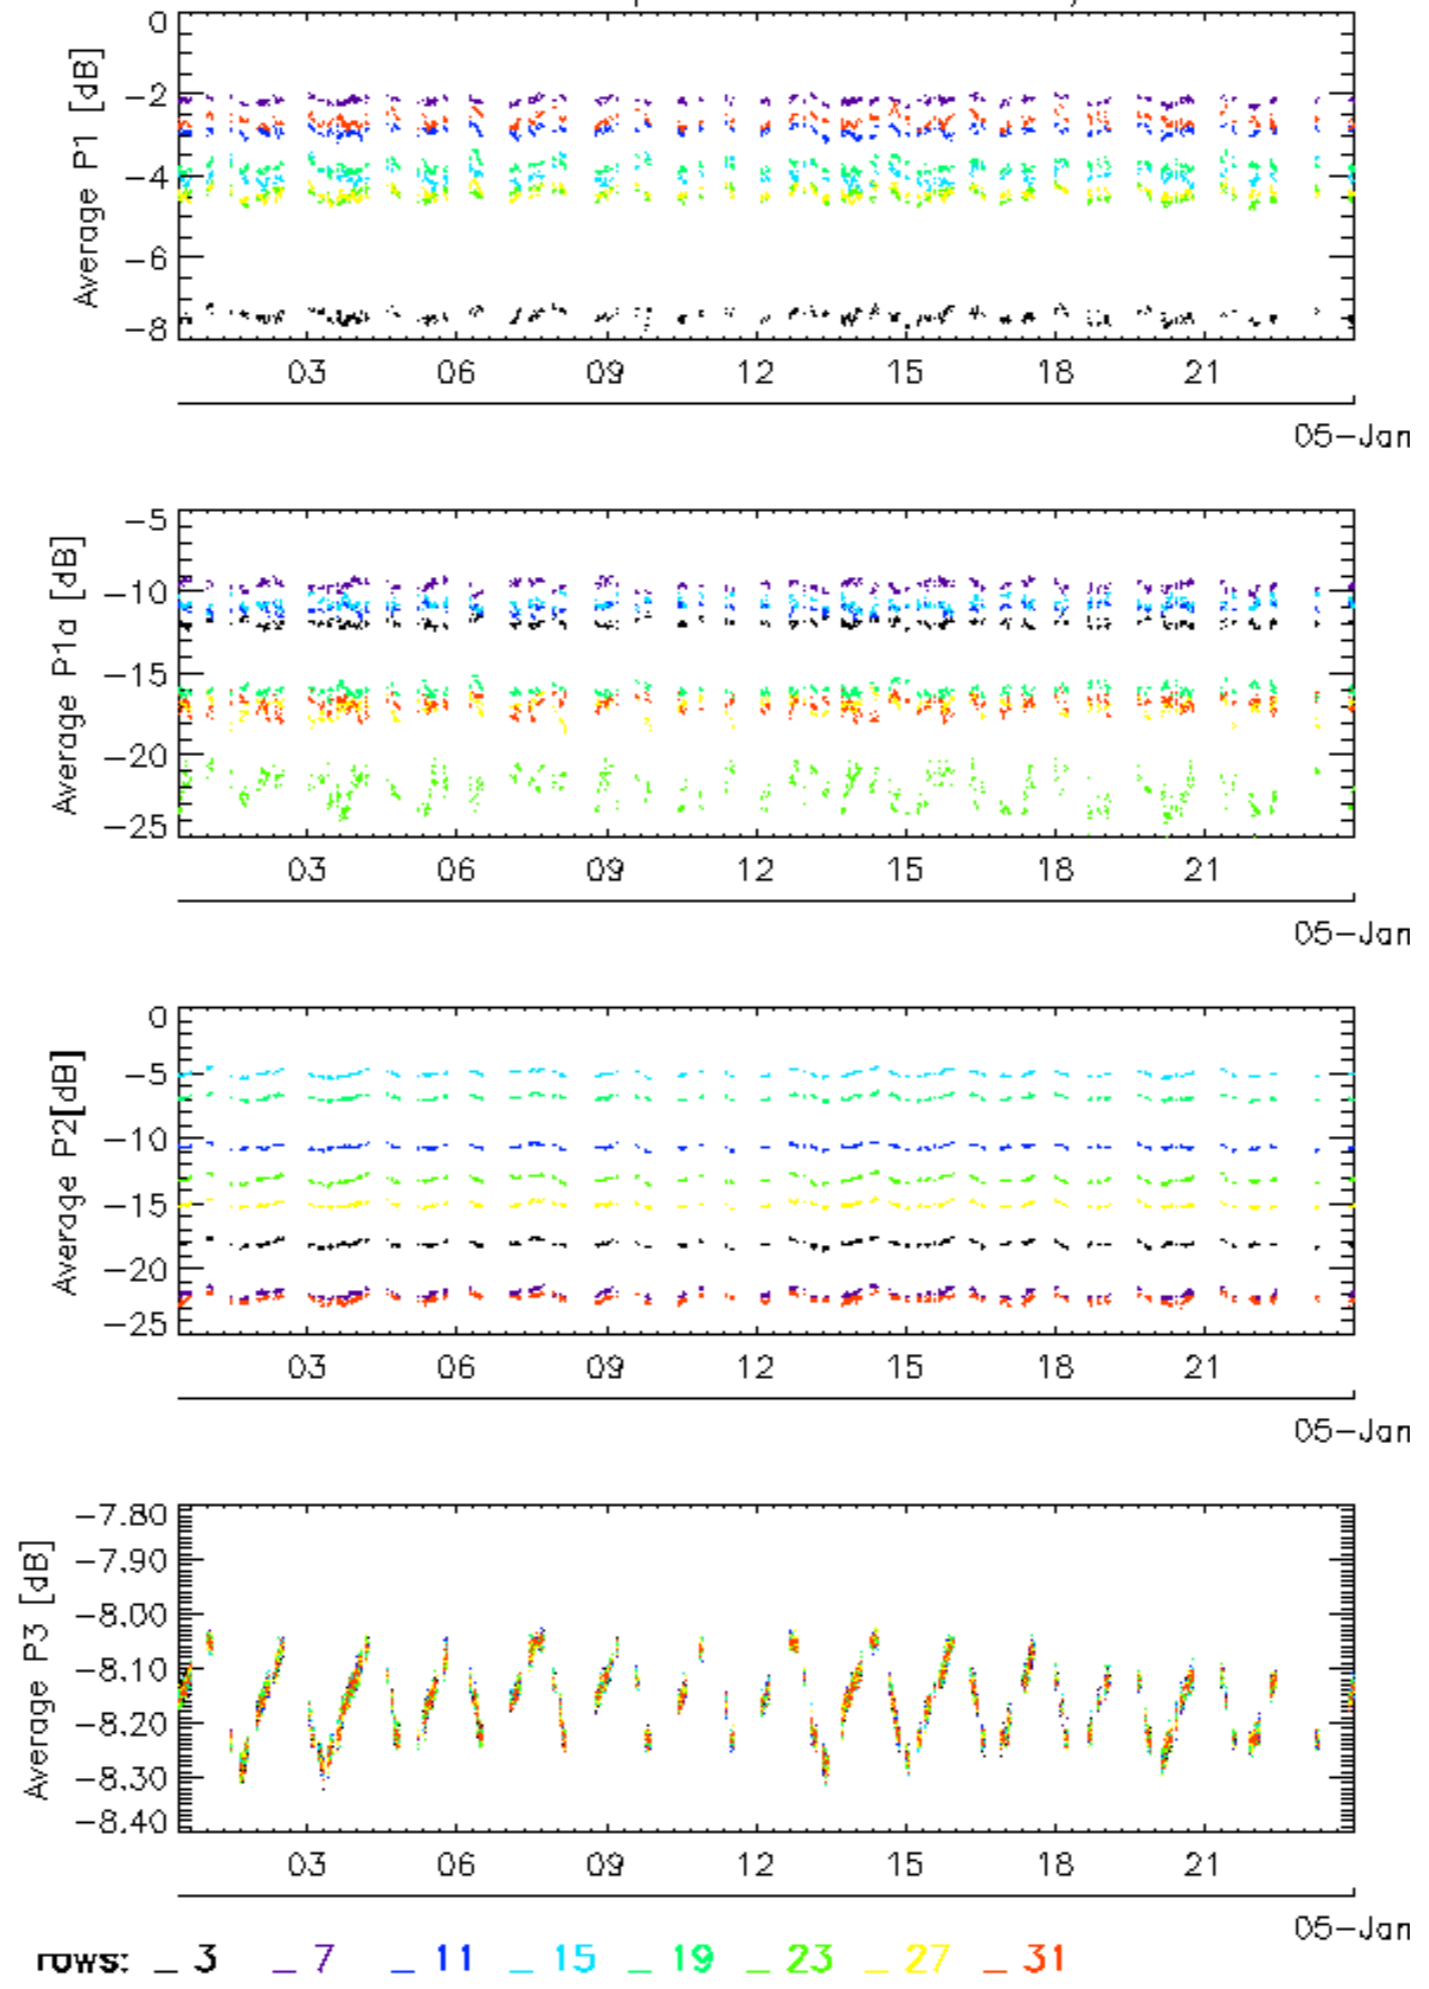


Calibration pulses for GM1 SS3 H/H

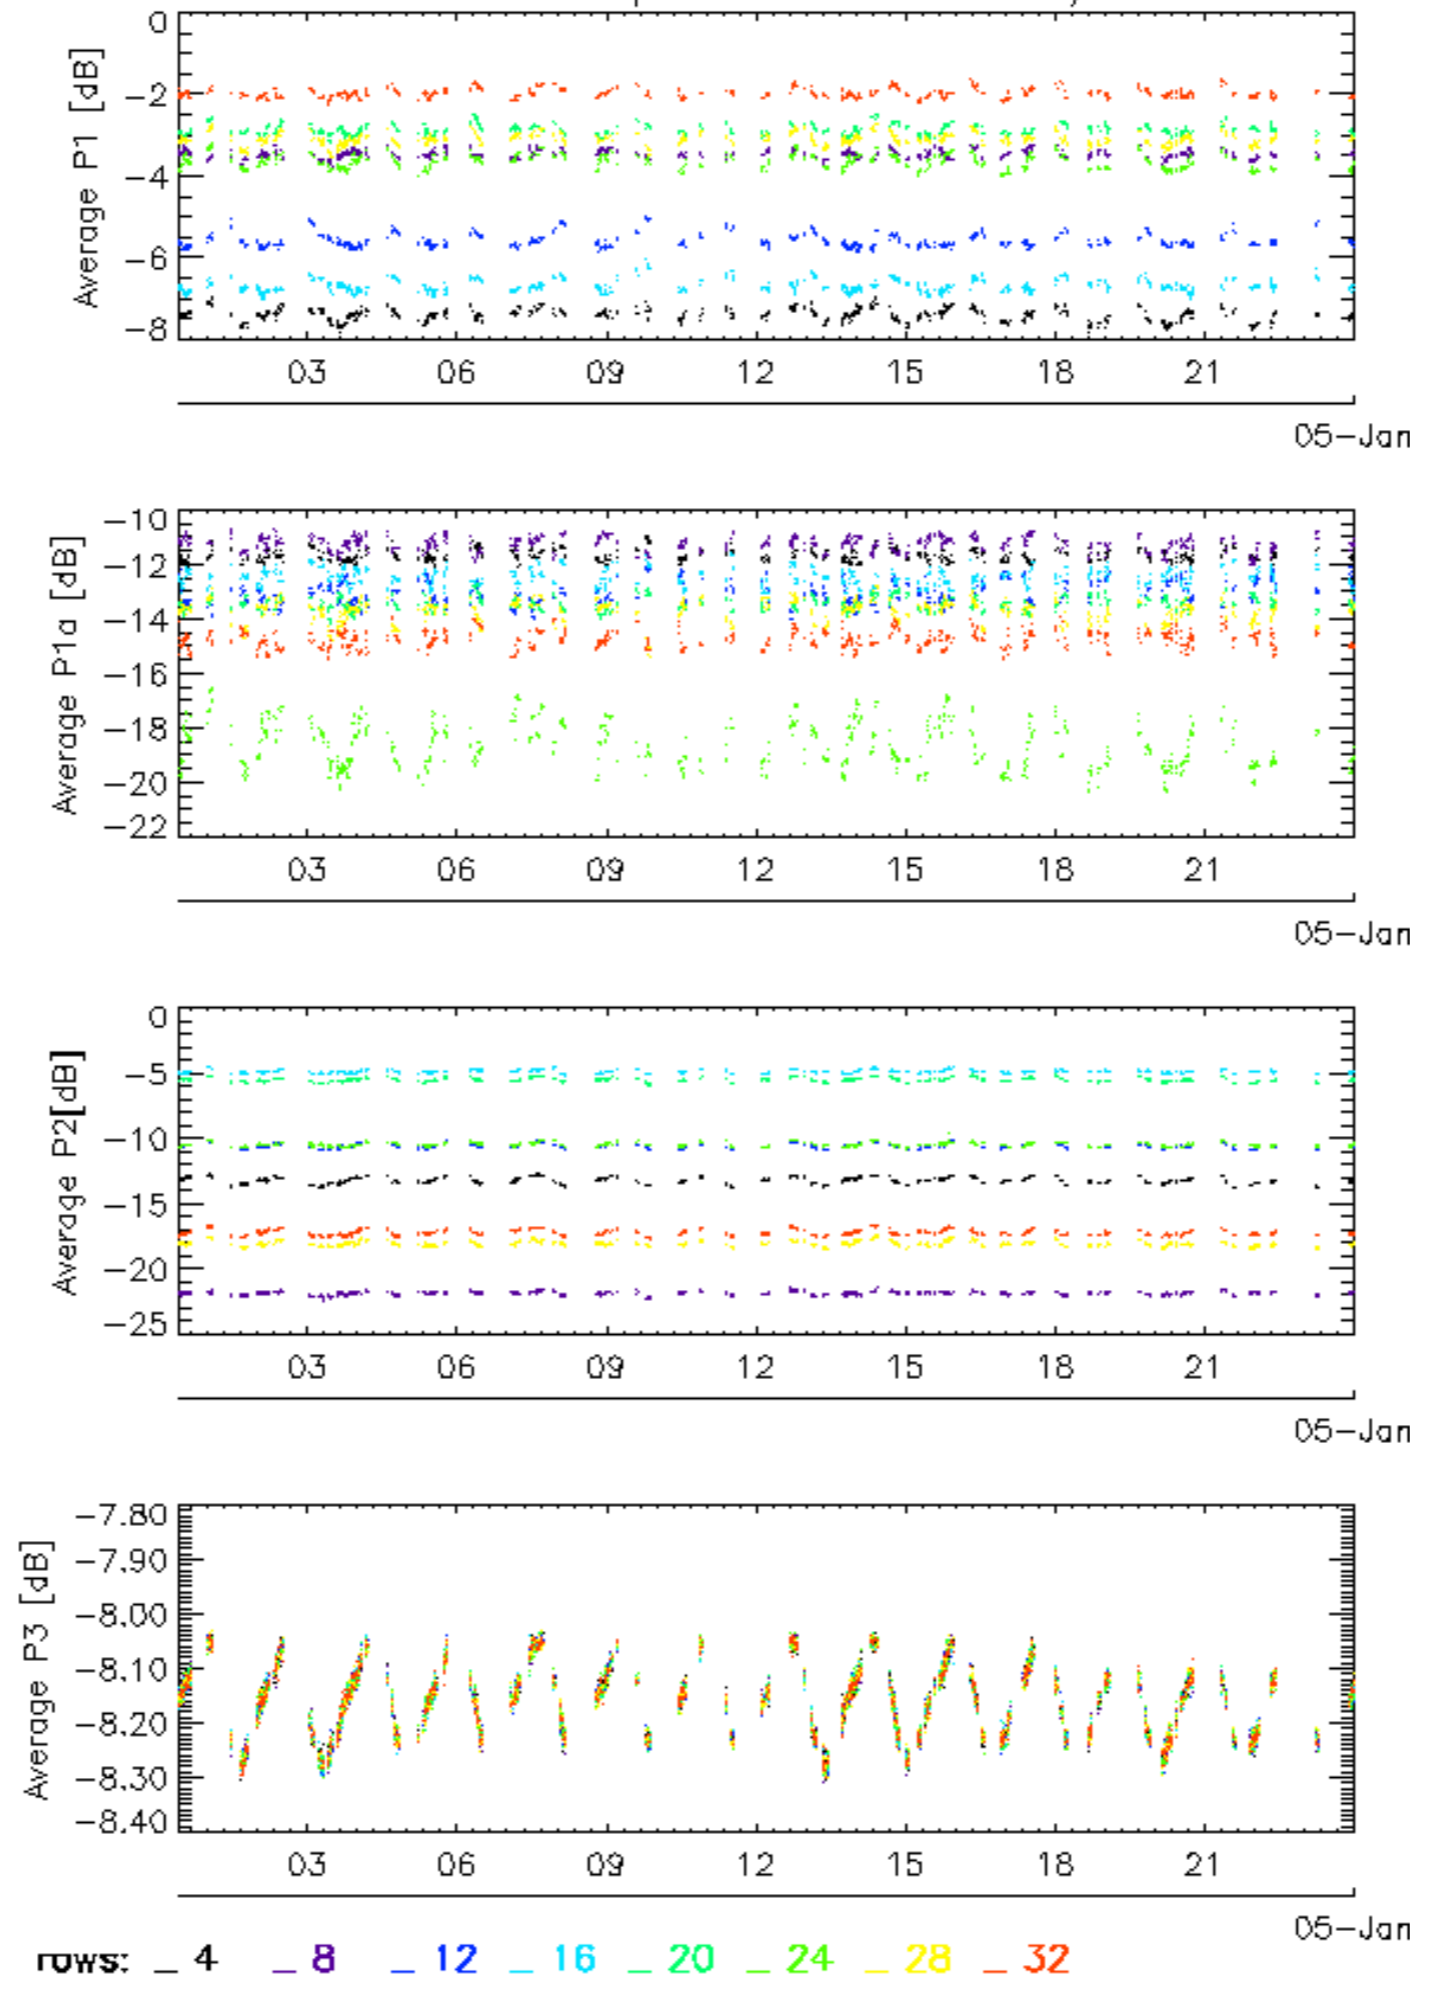


Calibration pulses for WVS IS2 V/V

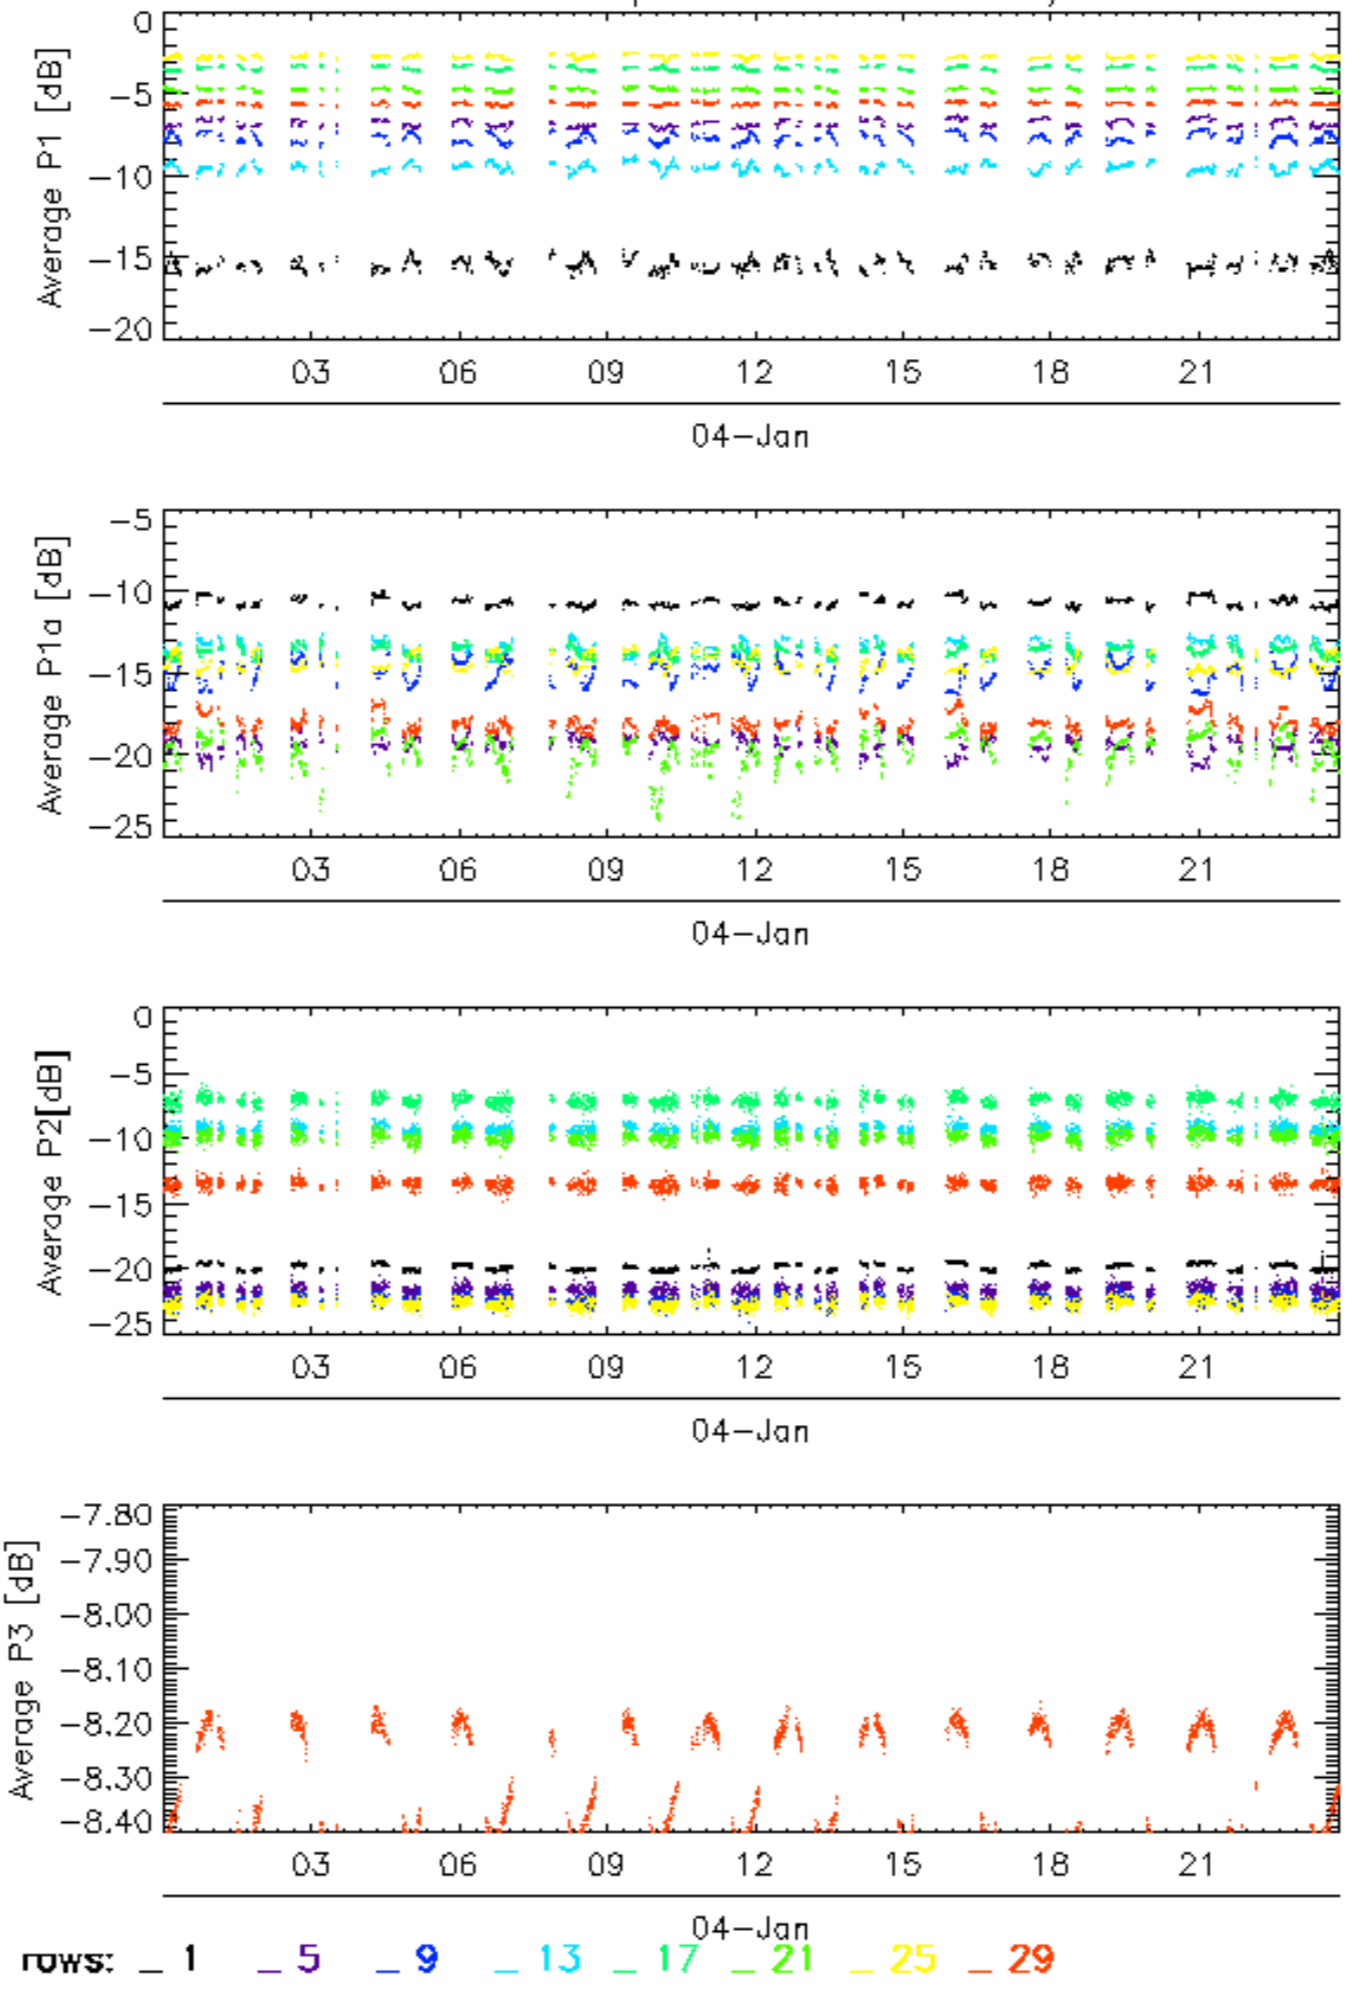


Calibration pulses for WVS IS2 V/V

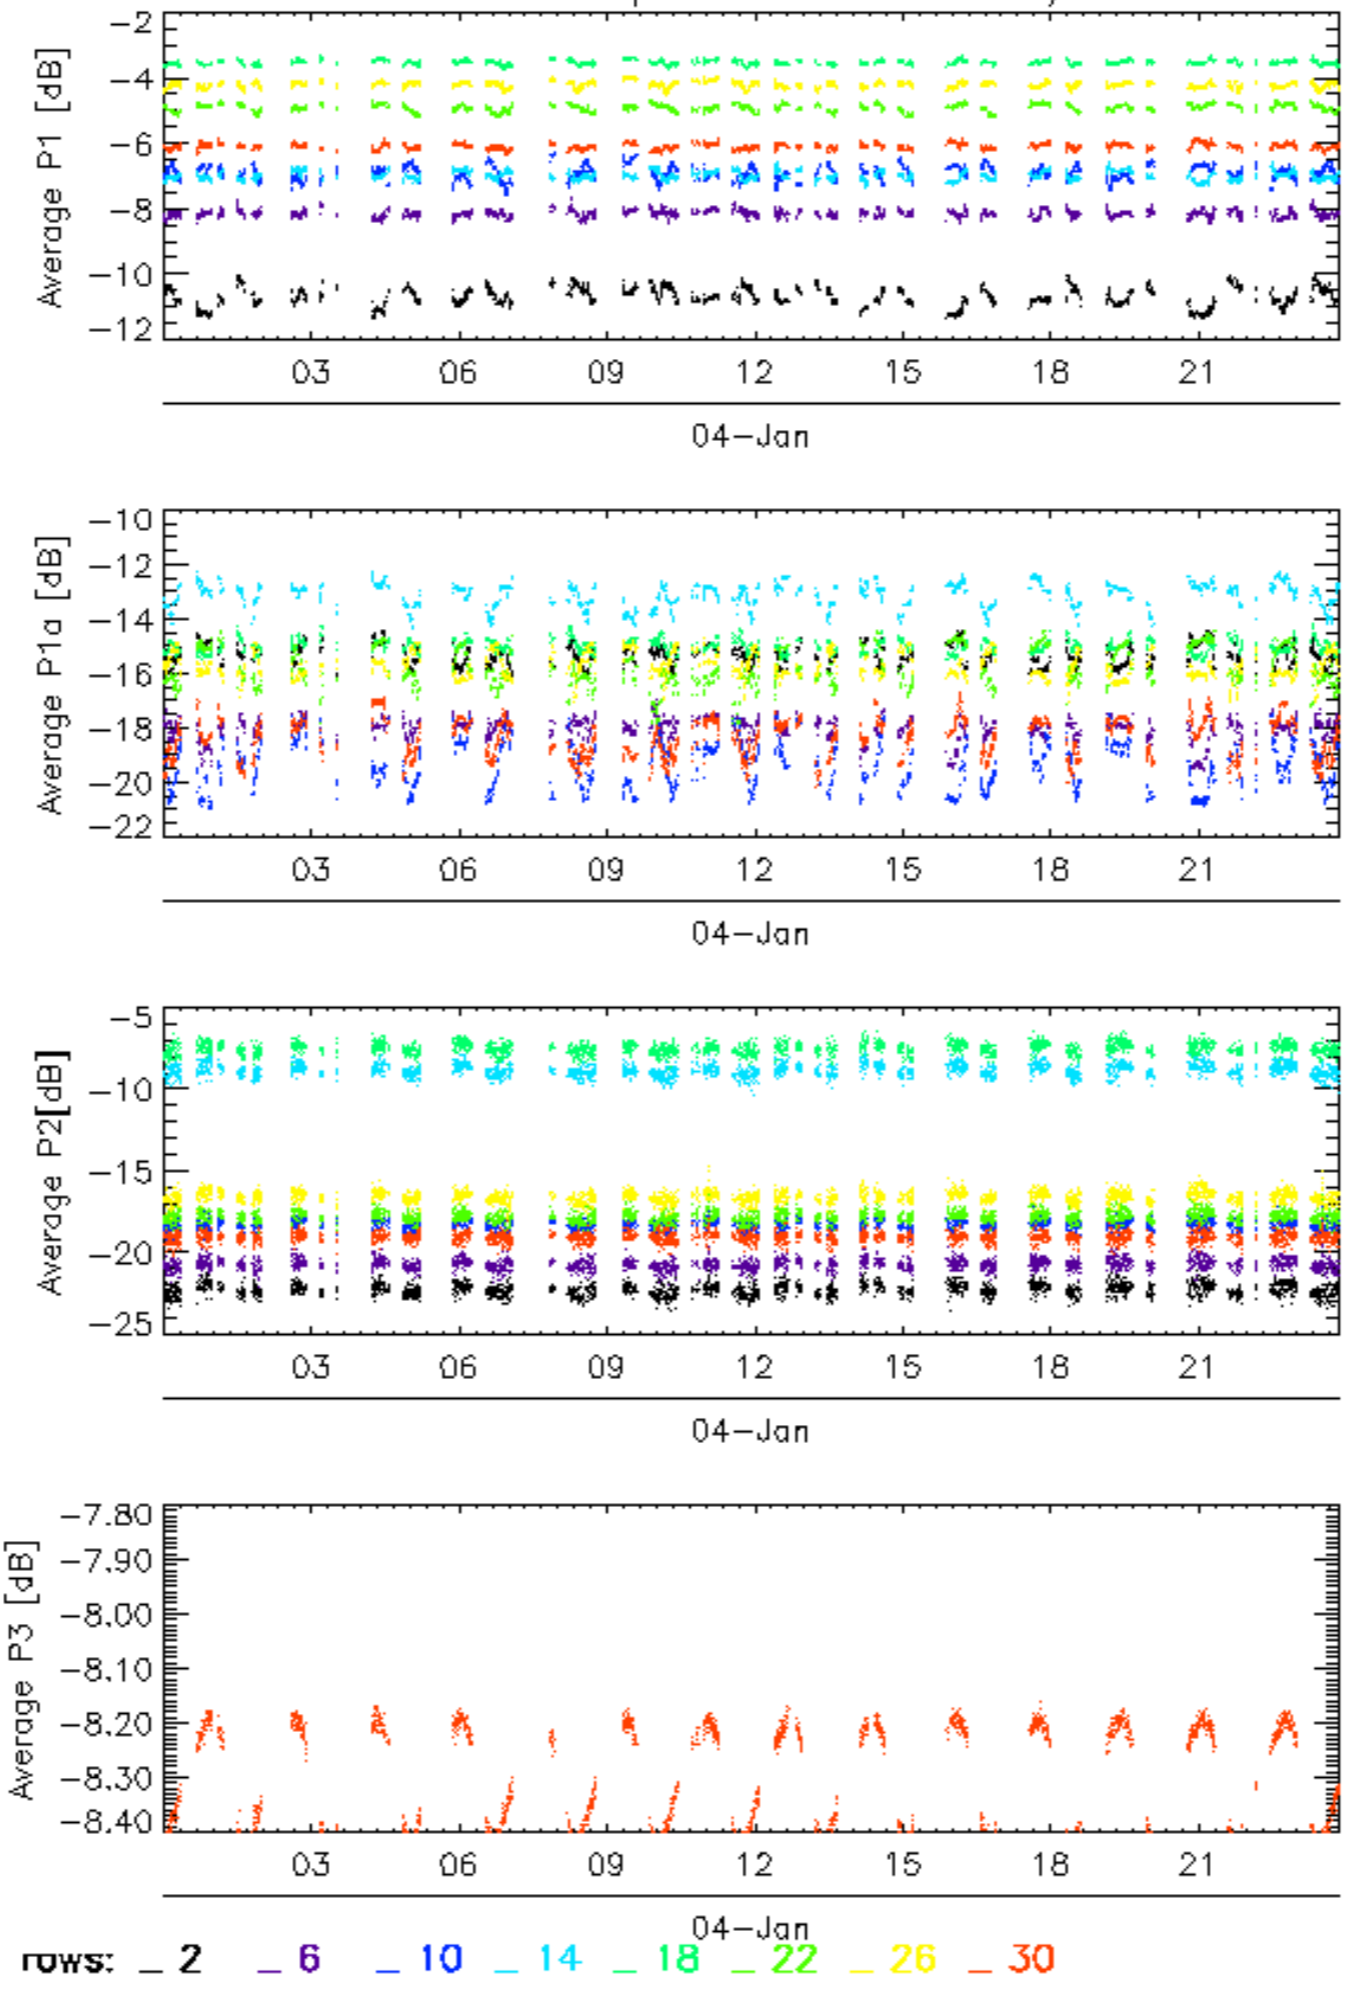



Calibration pulses for WVS IS2 V/V


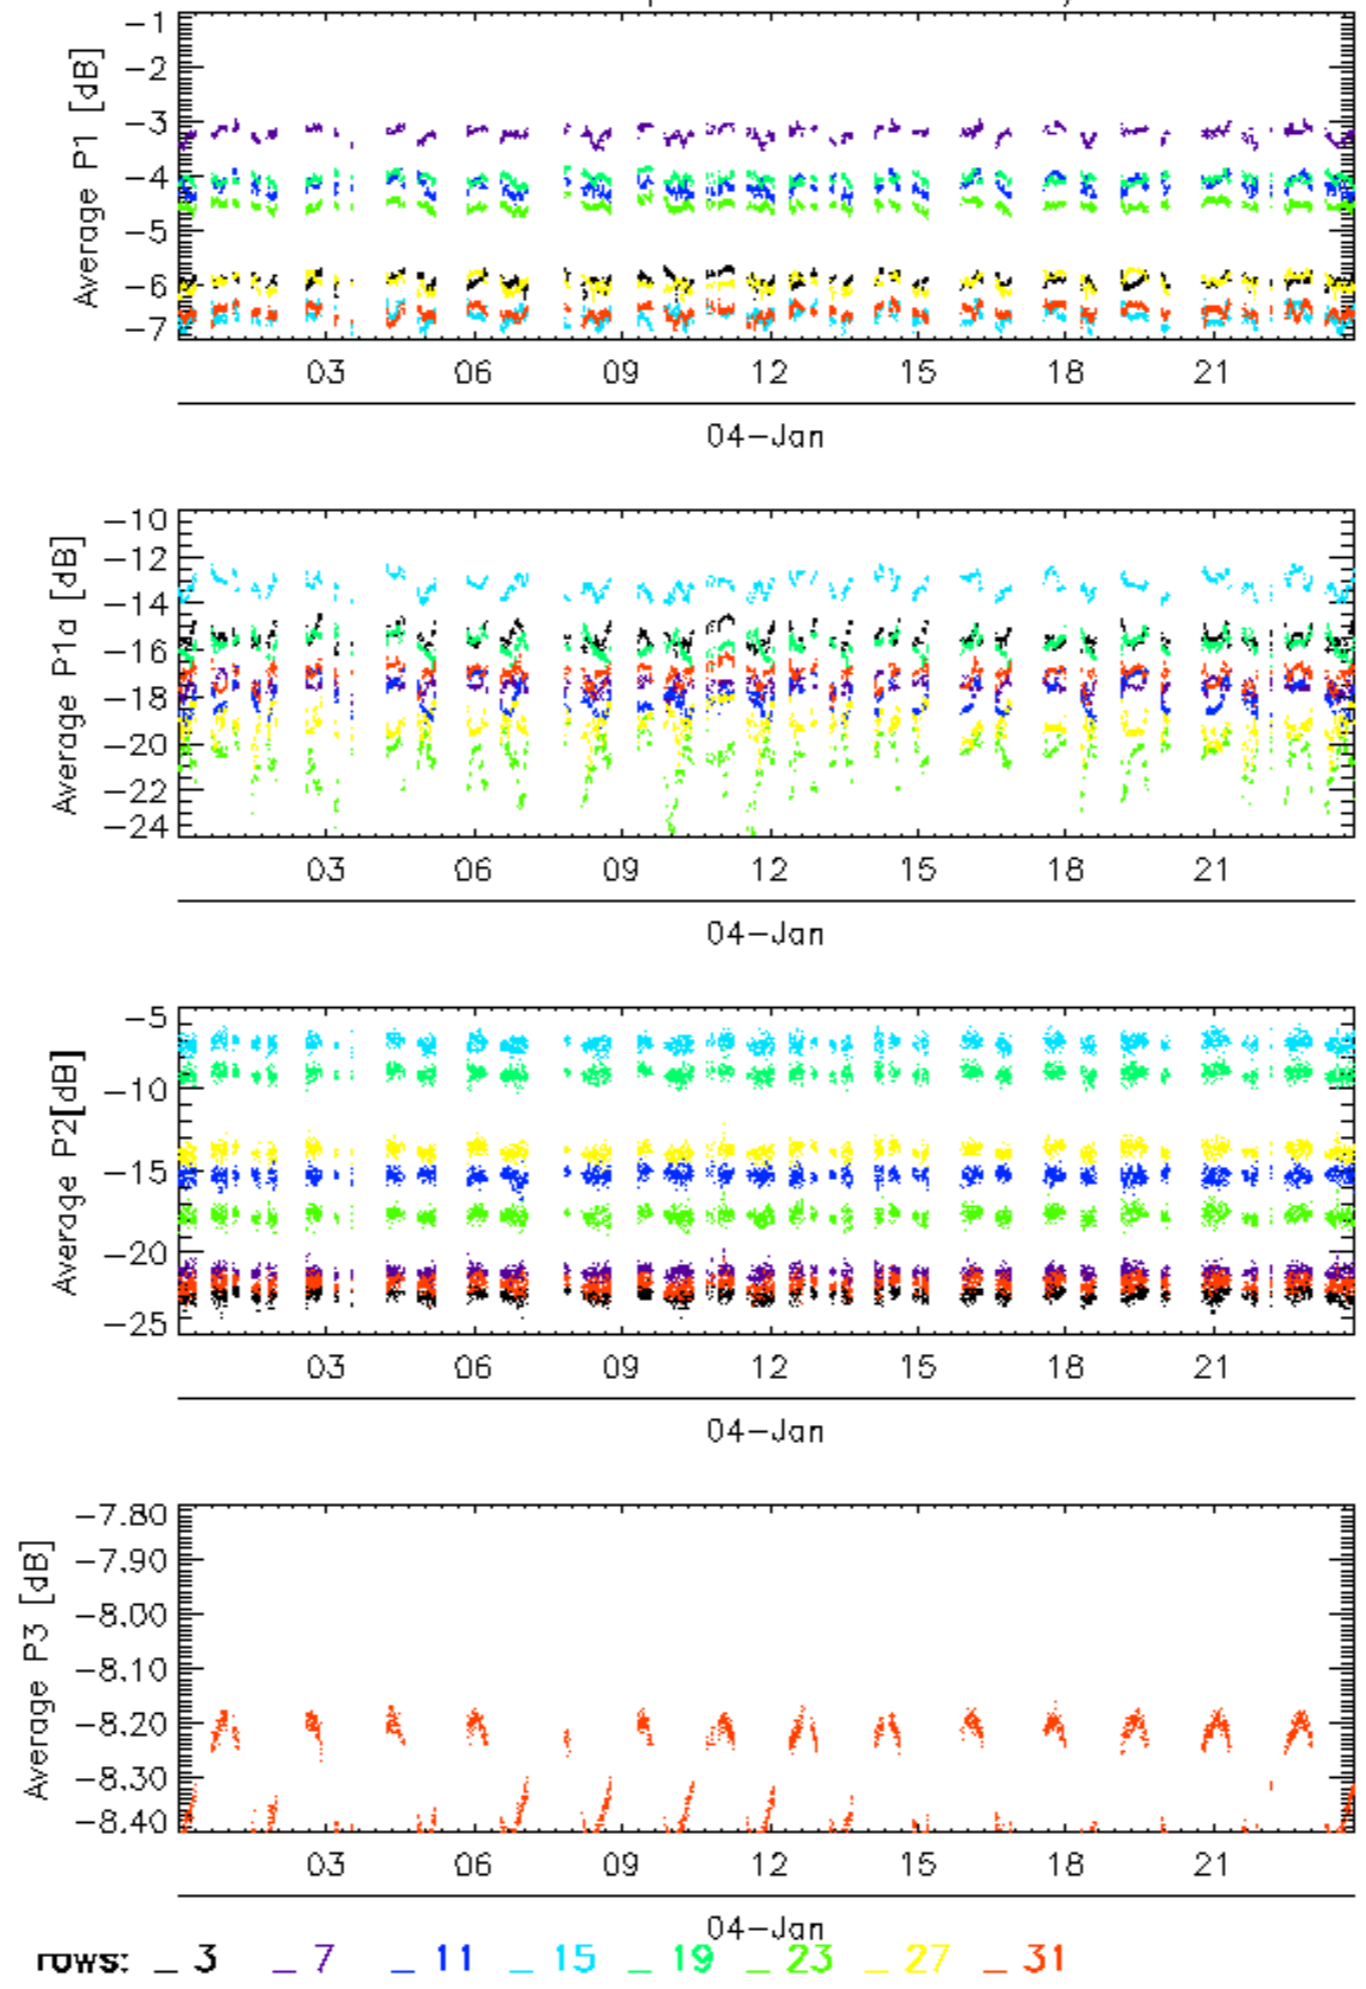


Calibration pulses for WVS IS2 V/V


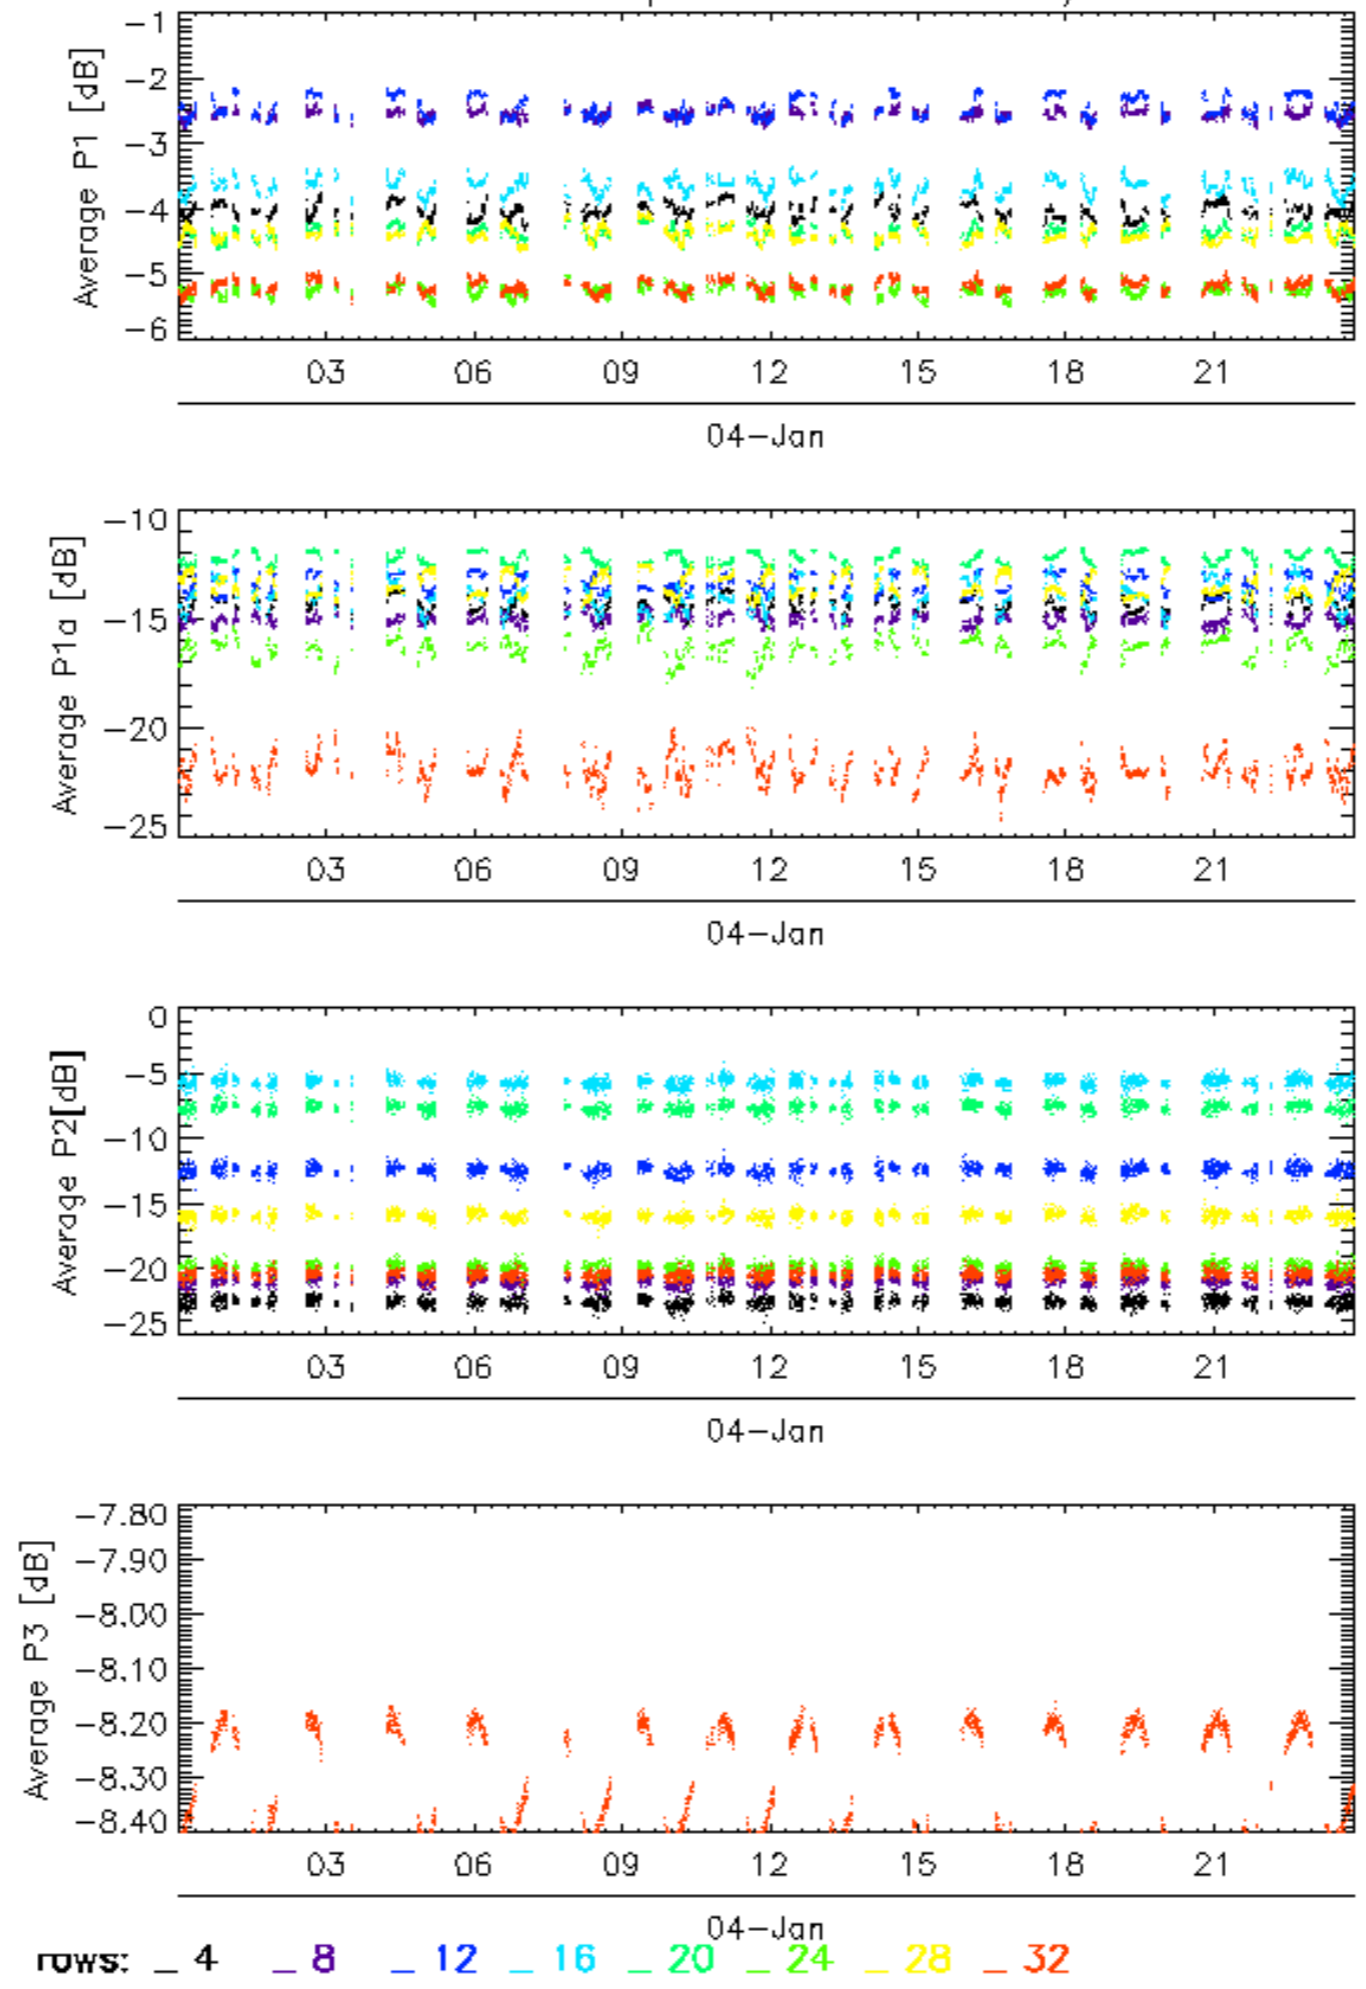


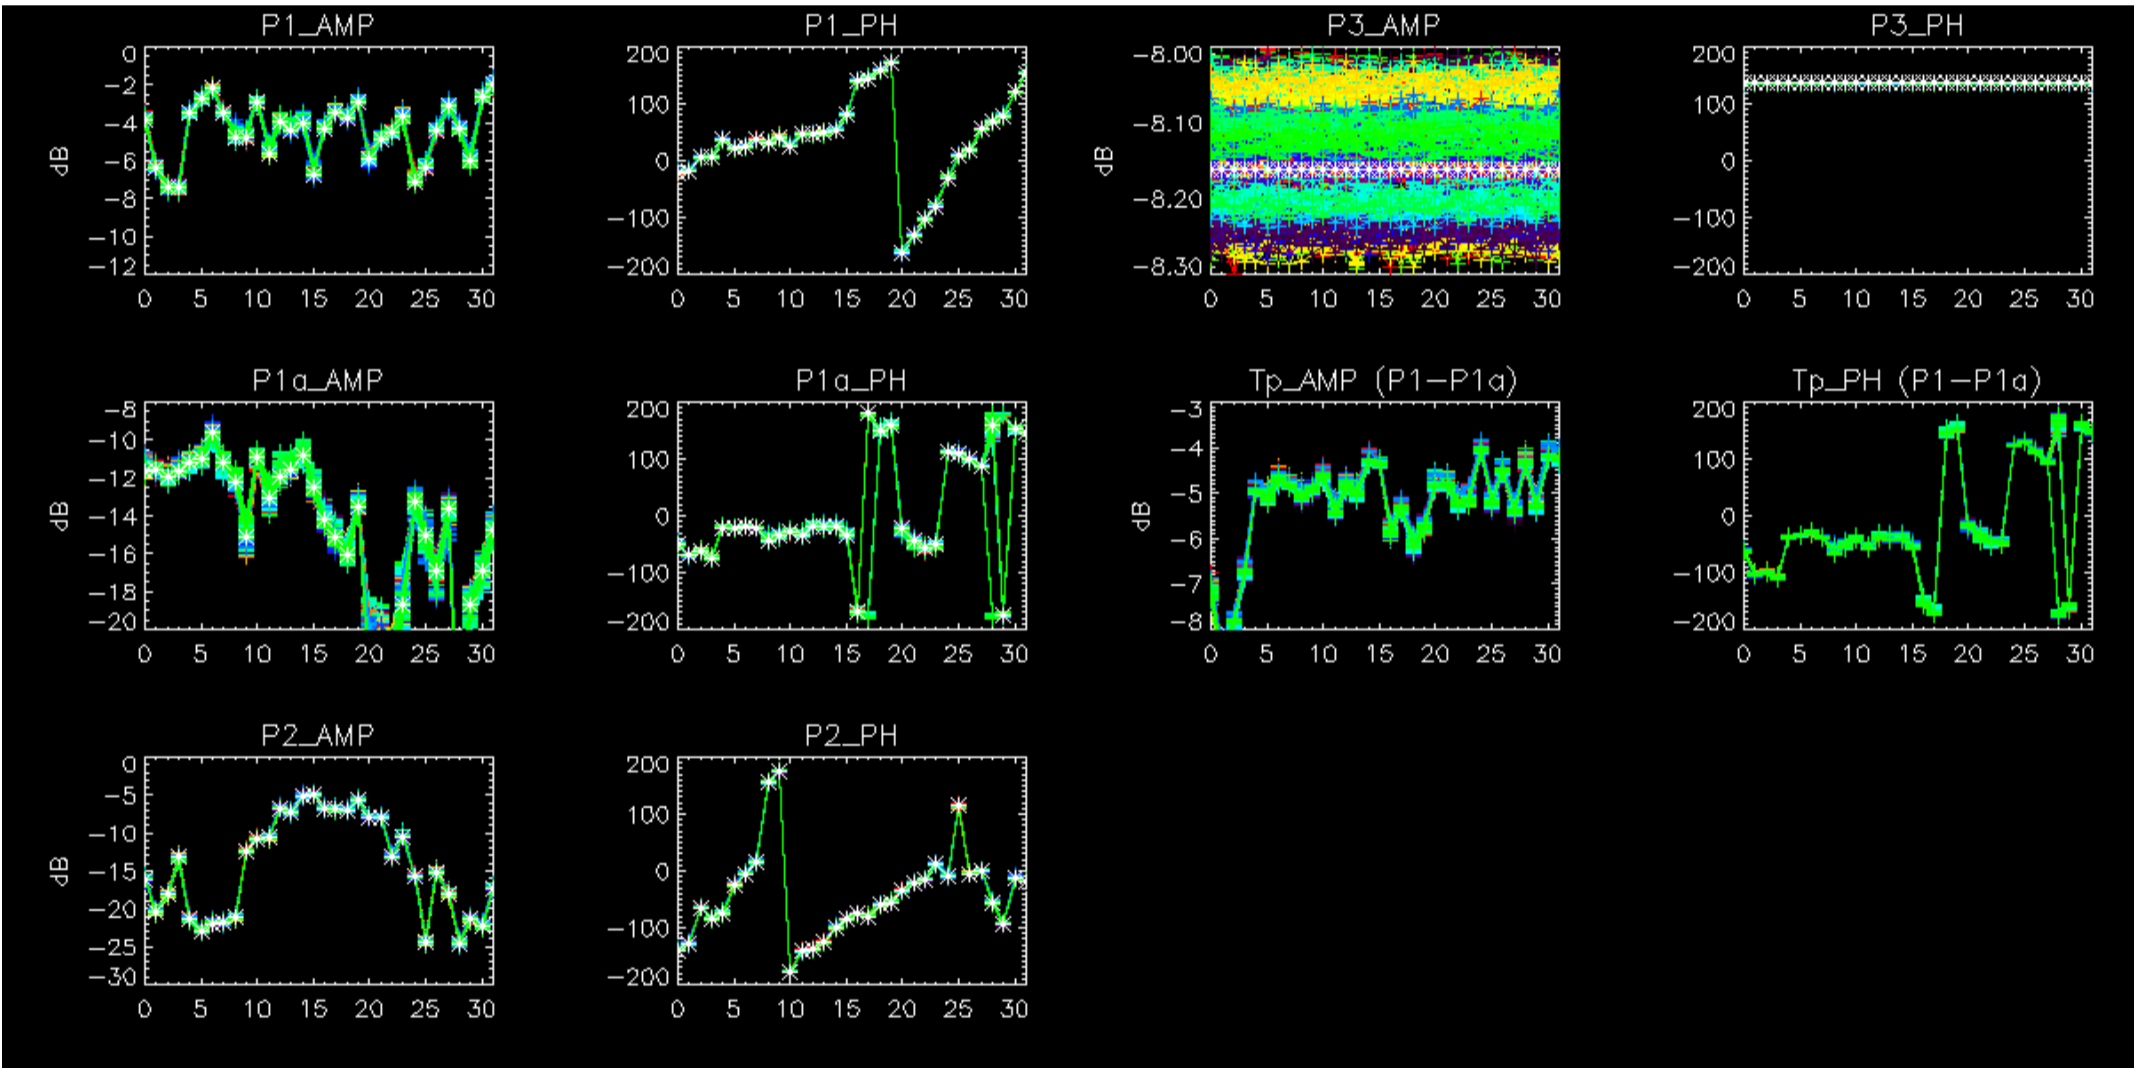


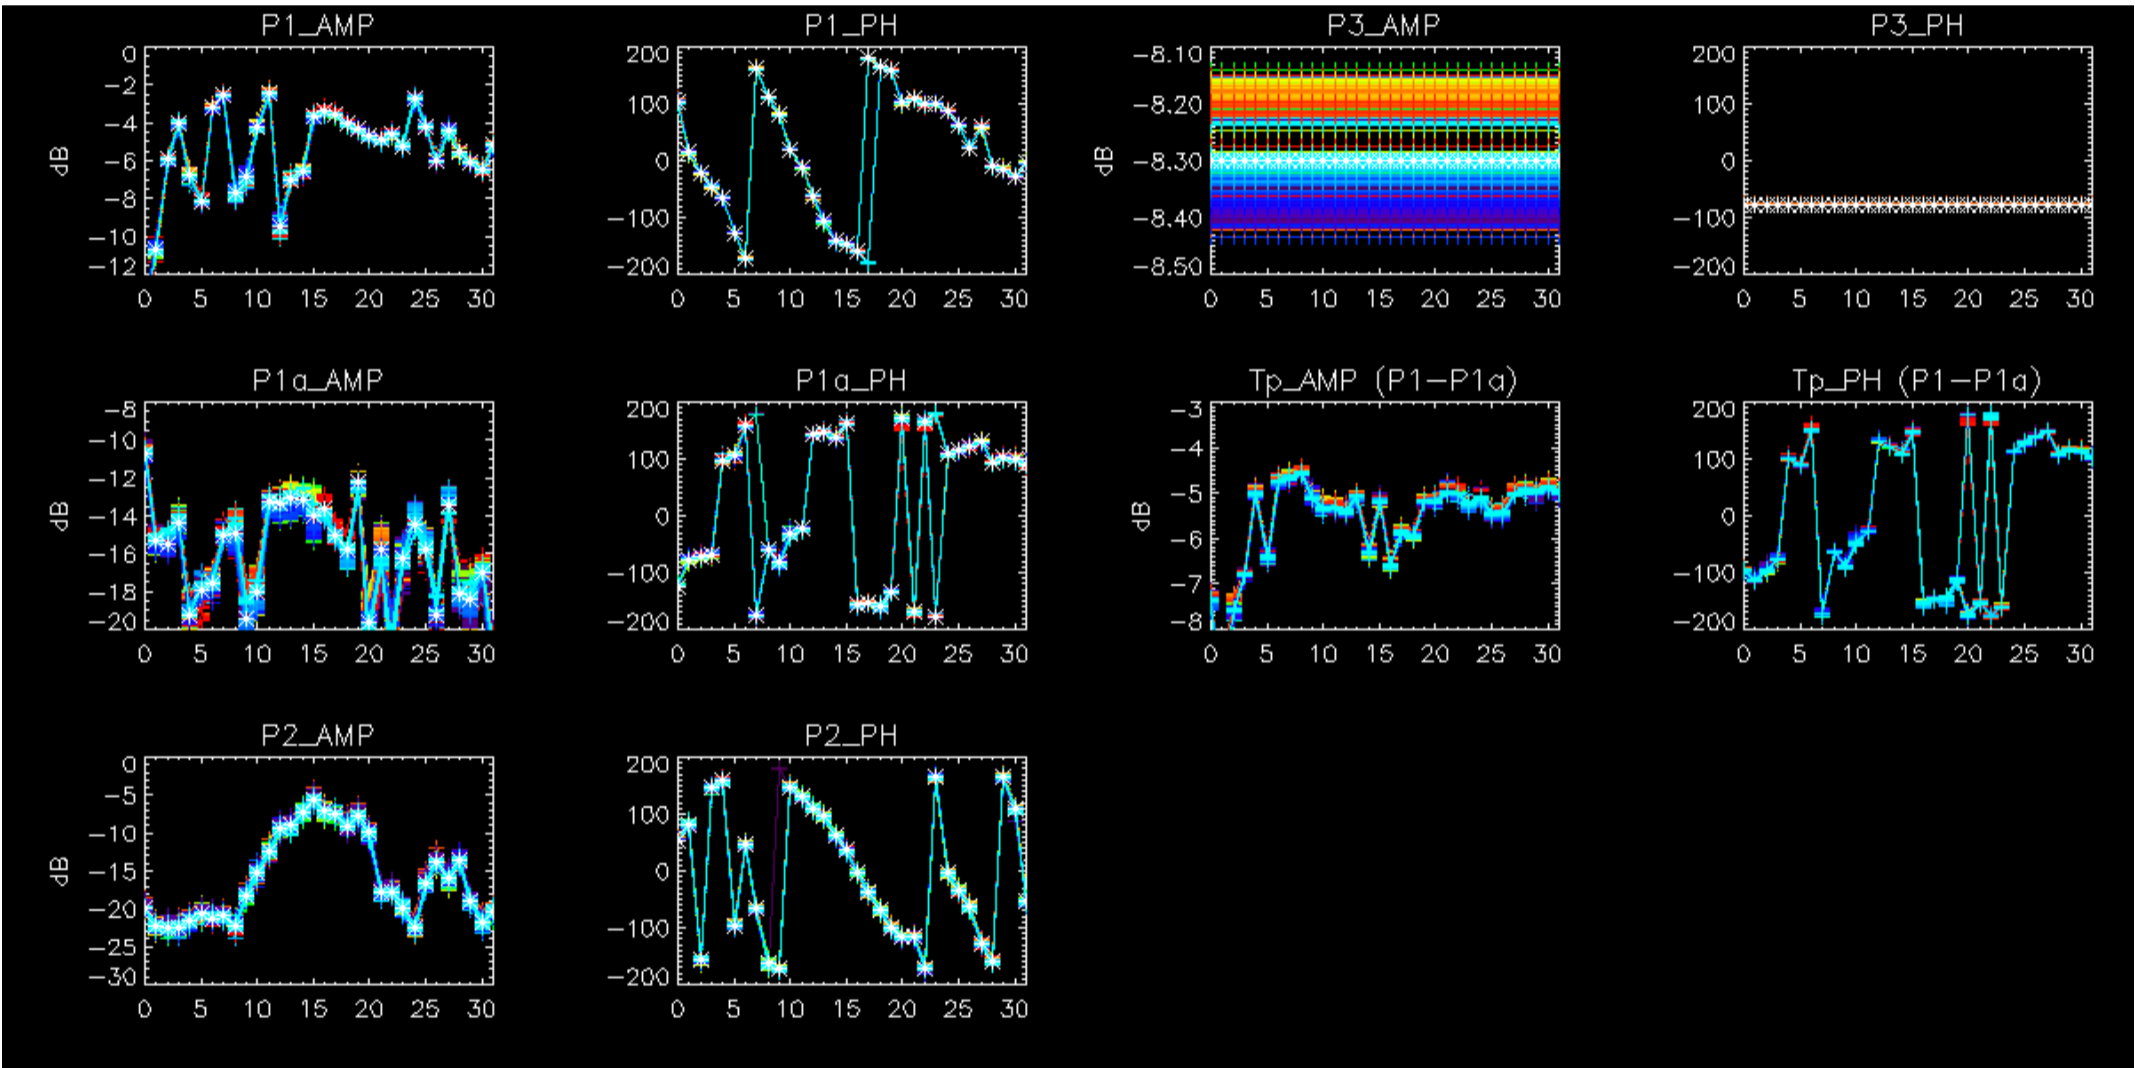


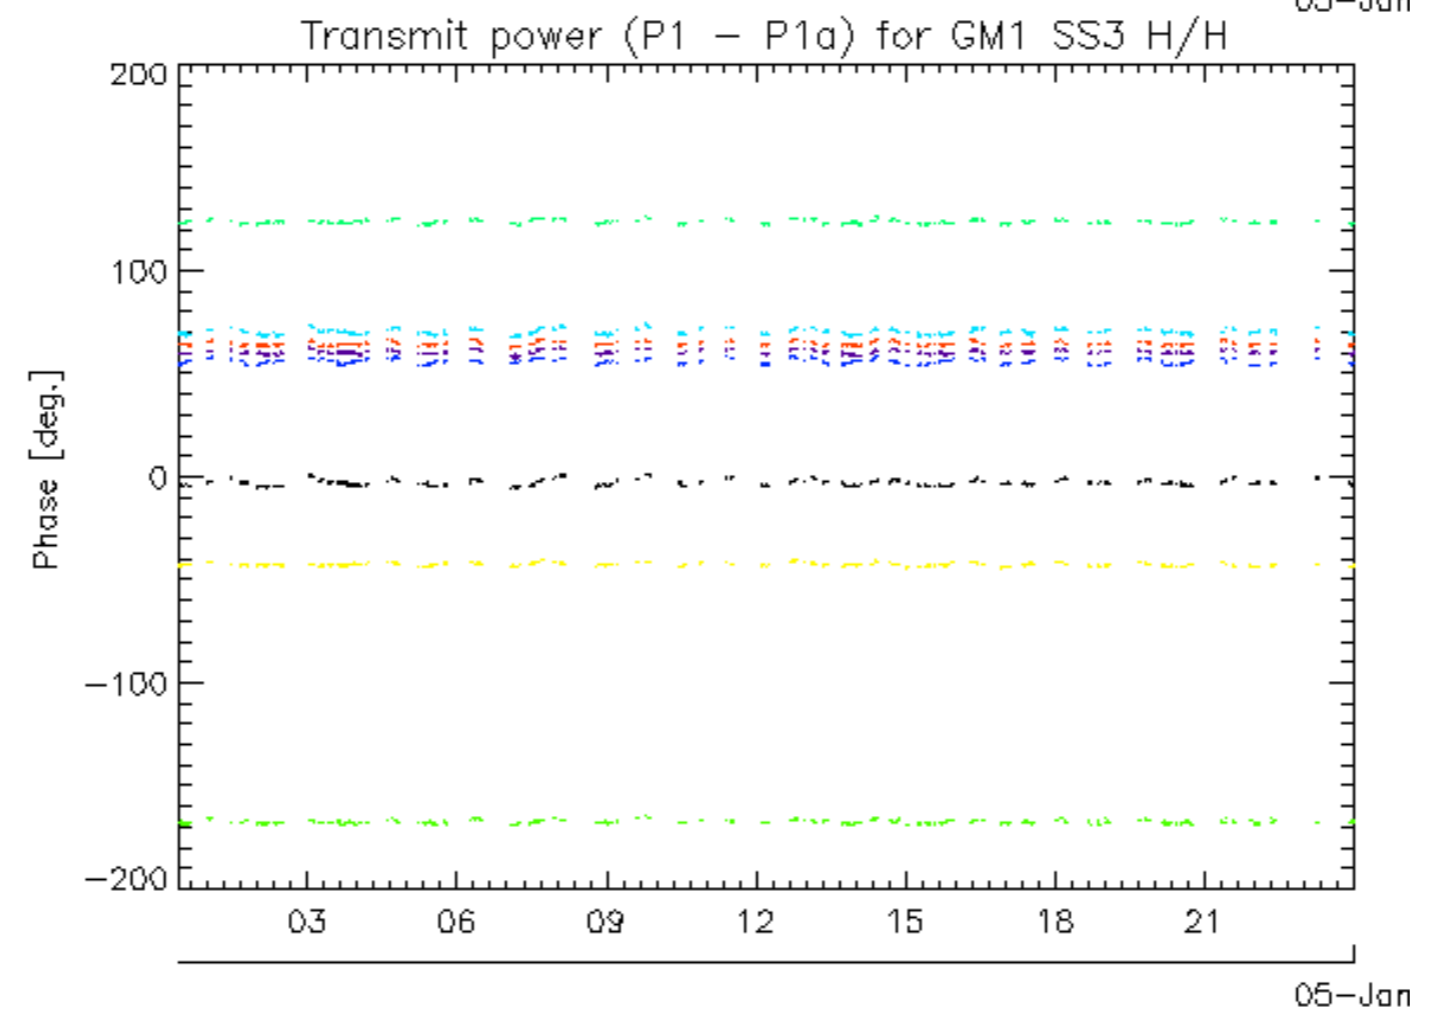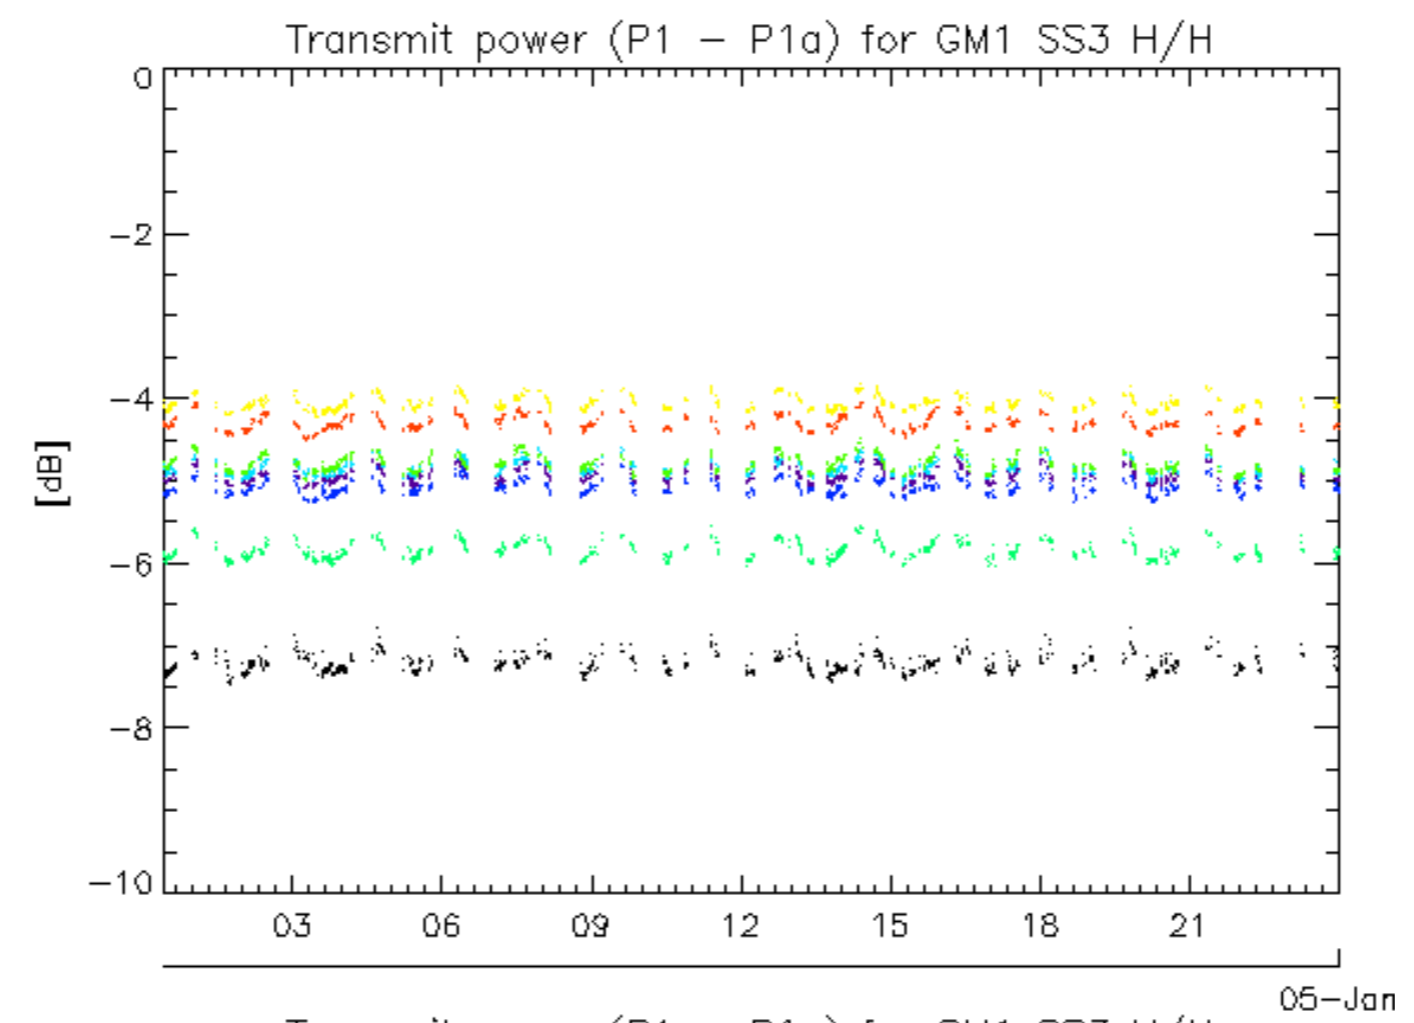



rows: _ 1 _ 5 _ 9 _ 13 _ 17 _ 21 _ 25 _ 29

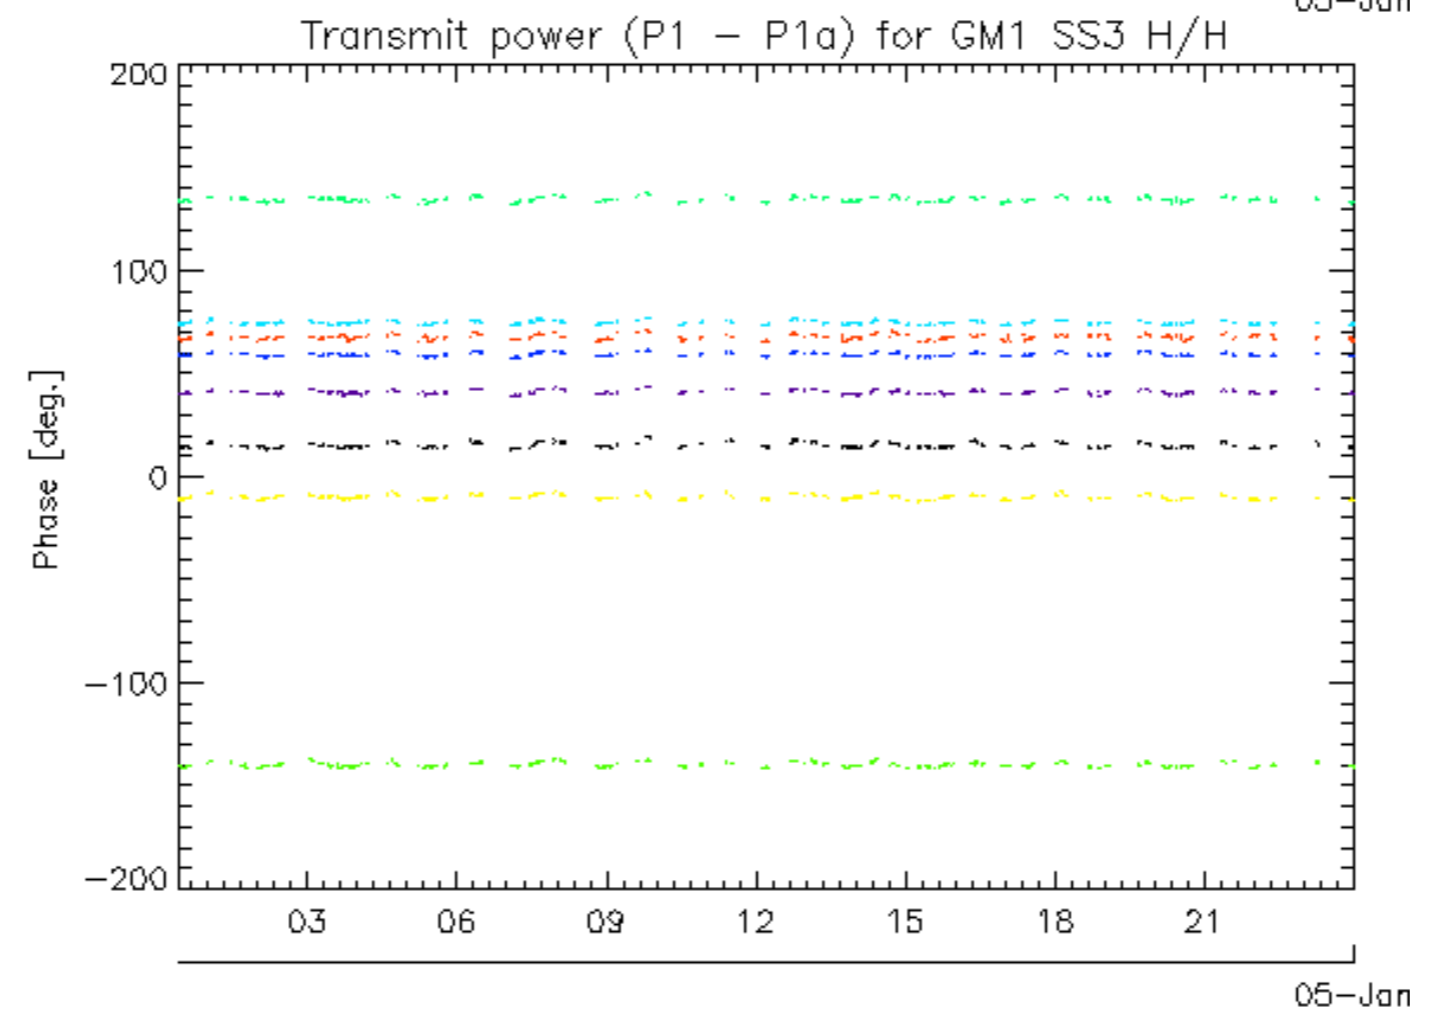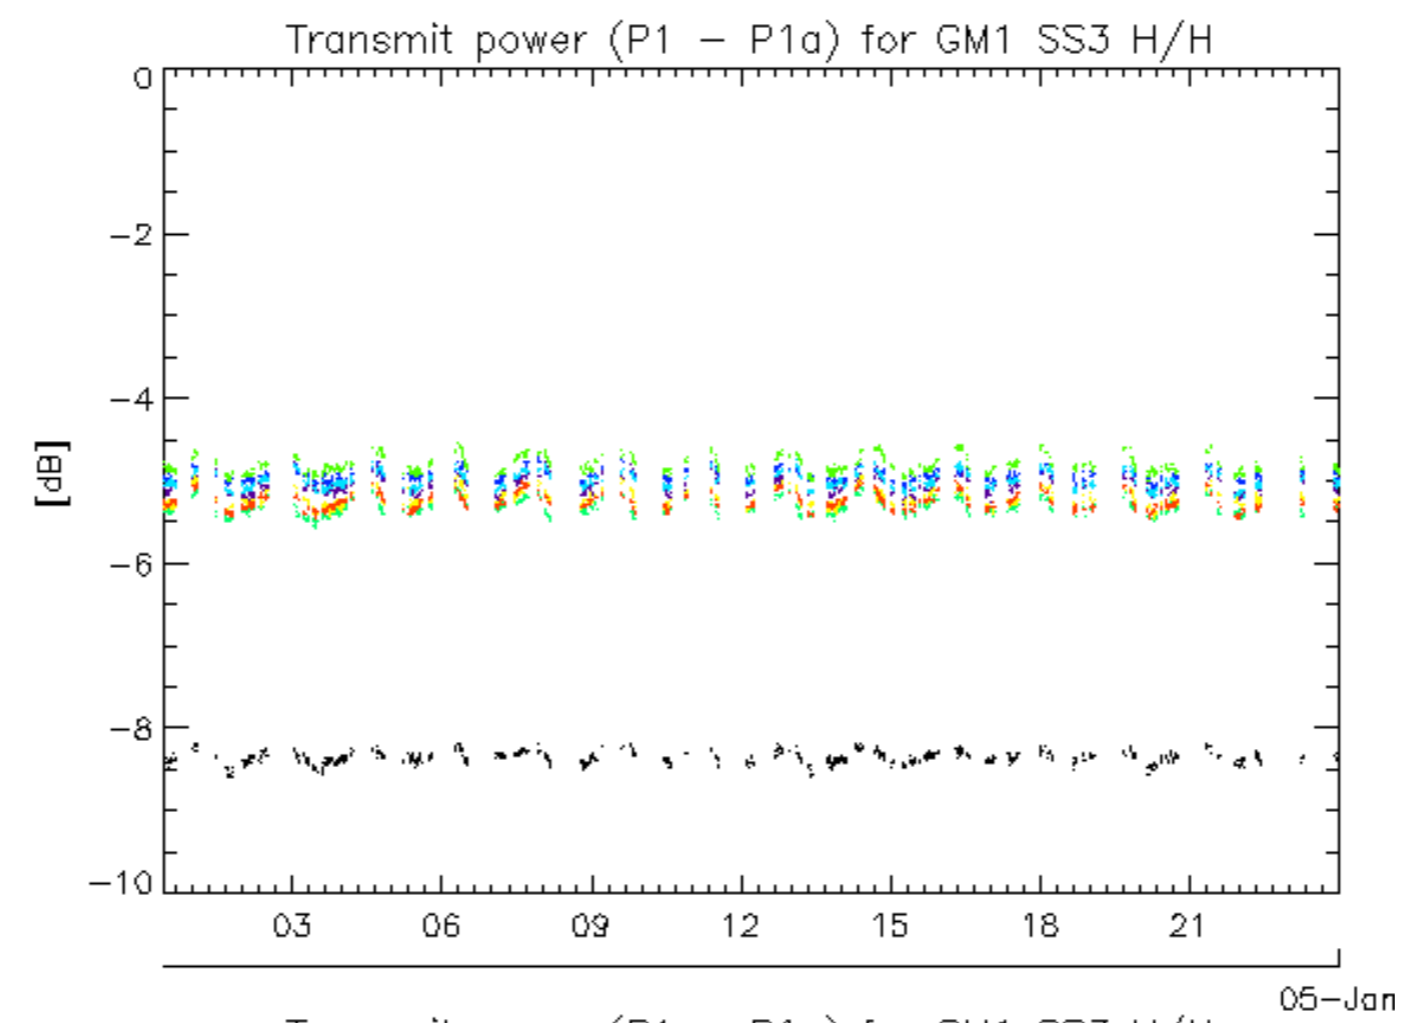



rows: _ 2 _ 6 _ 10 _ 14 _ 18 _ 22 _ 26 _ 30

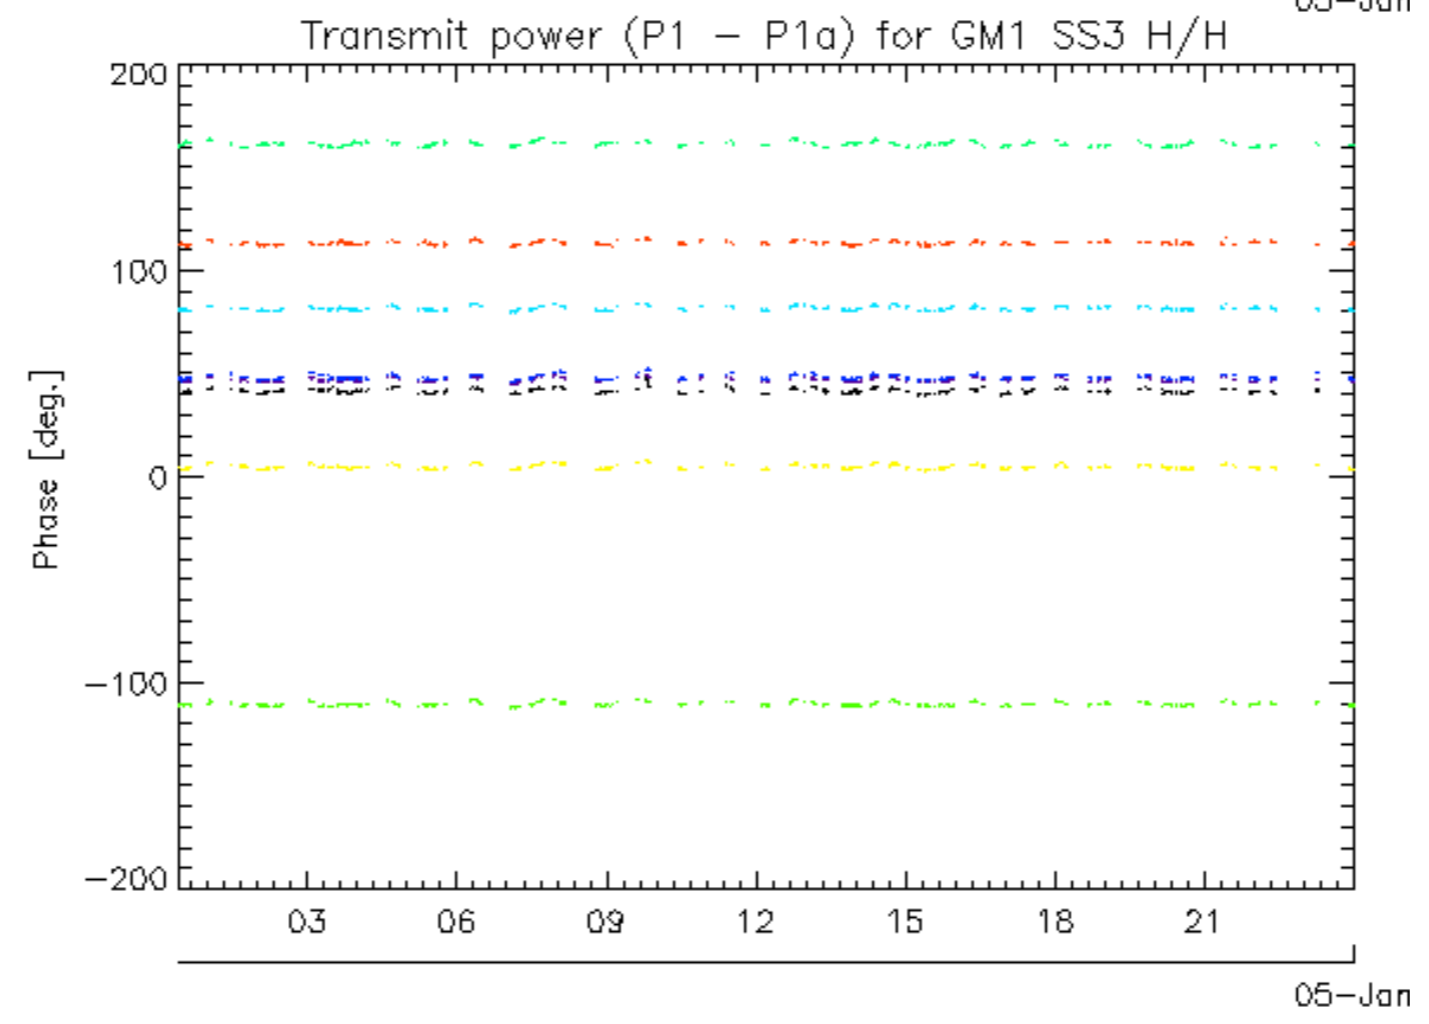
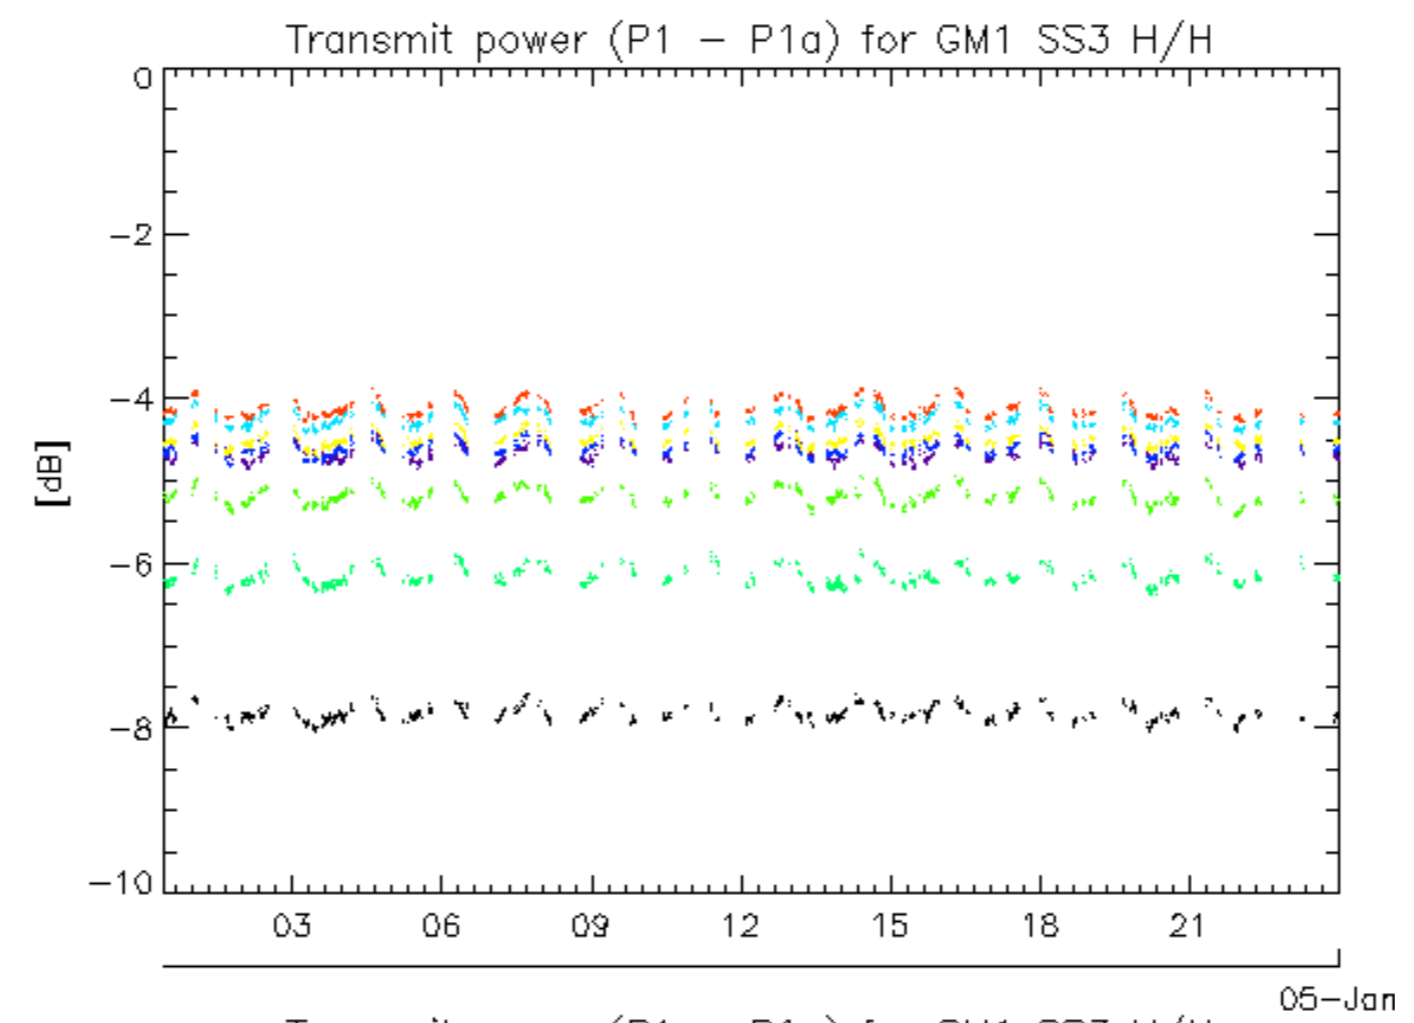




rows: _ 3 _ 7 _ 11 _ 15 _ 19 _ 23 _ 27 _ 31

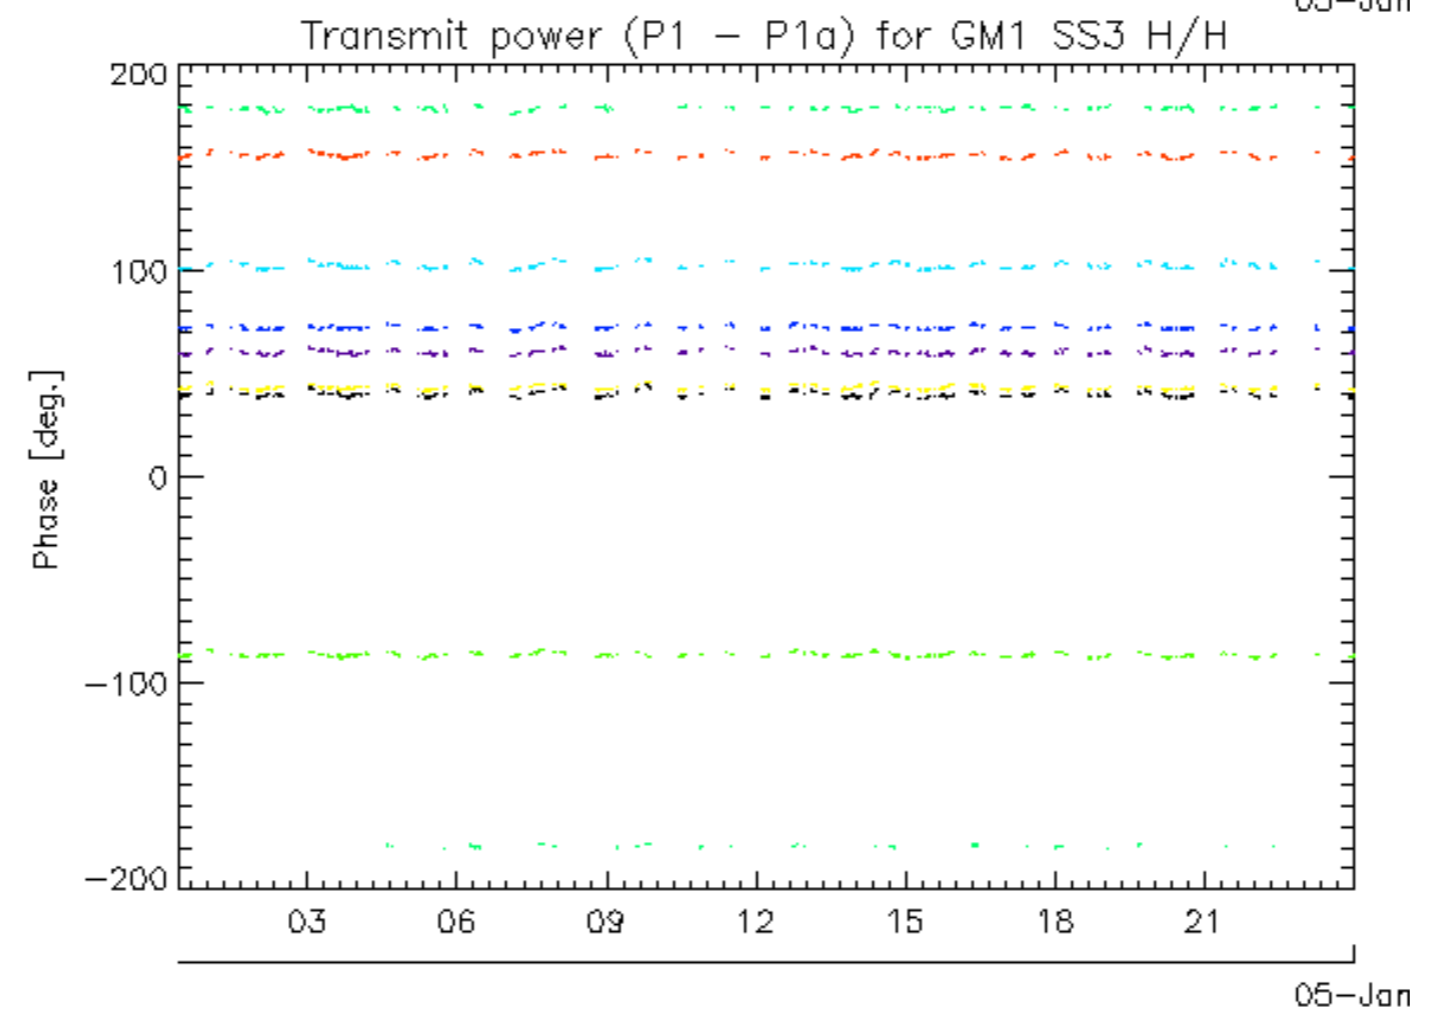
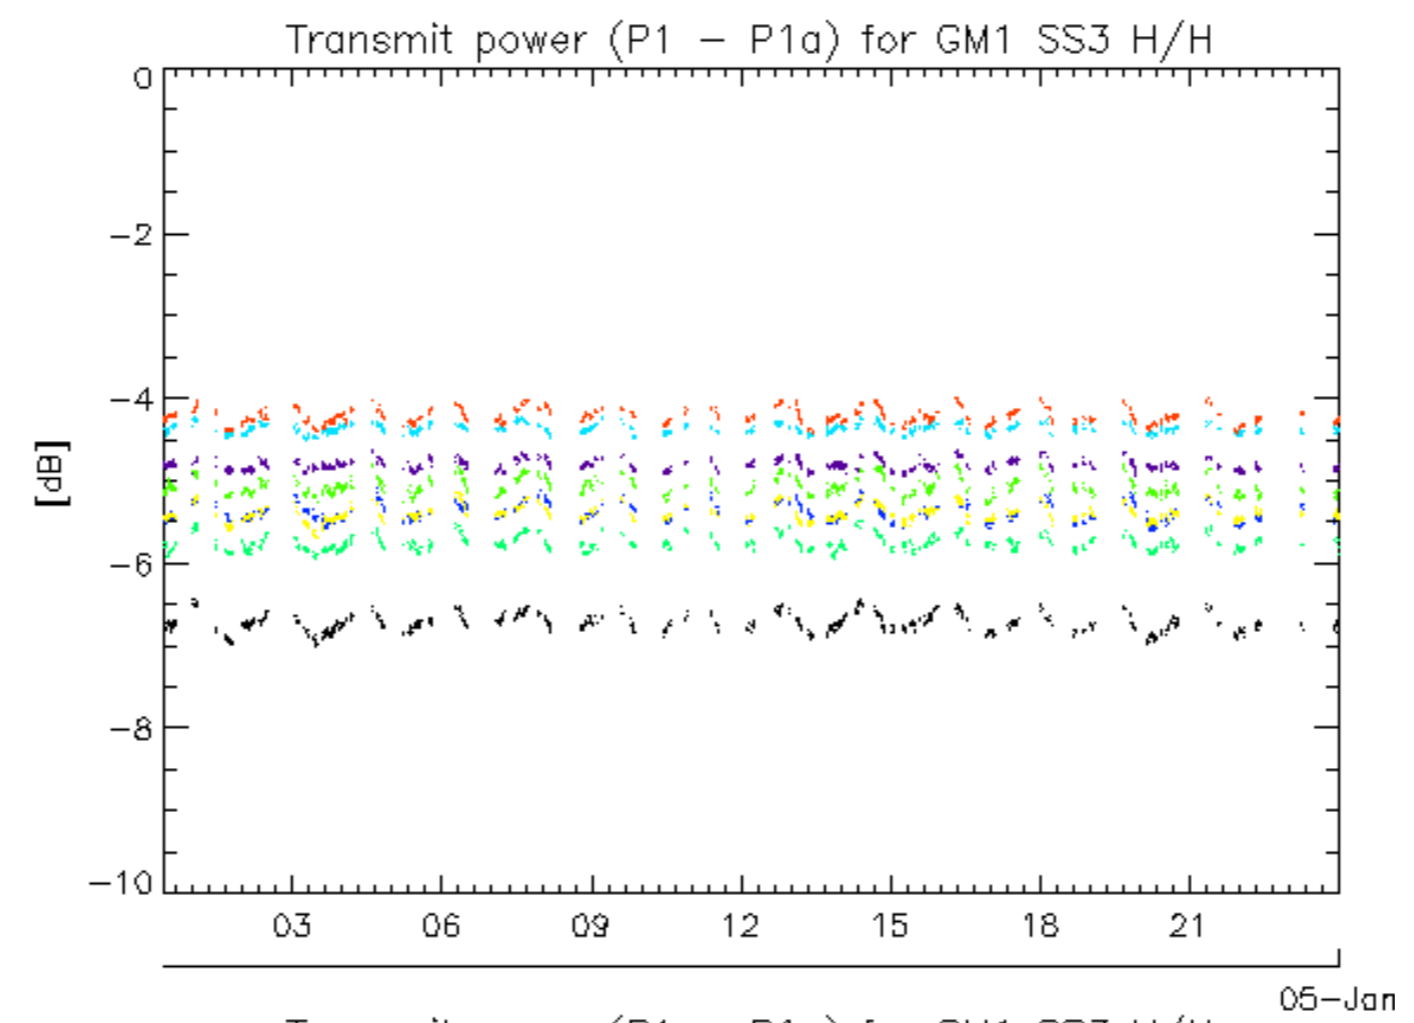



rows: _ 4 _ 8 _ 12 _ 16 _ 20 _ 24 _ 28 _ 32

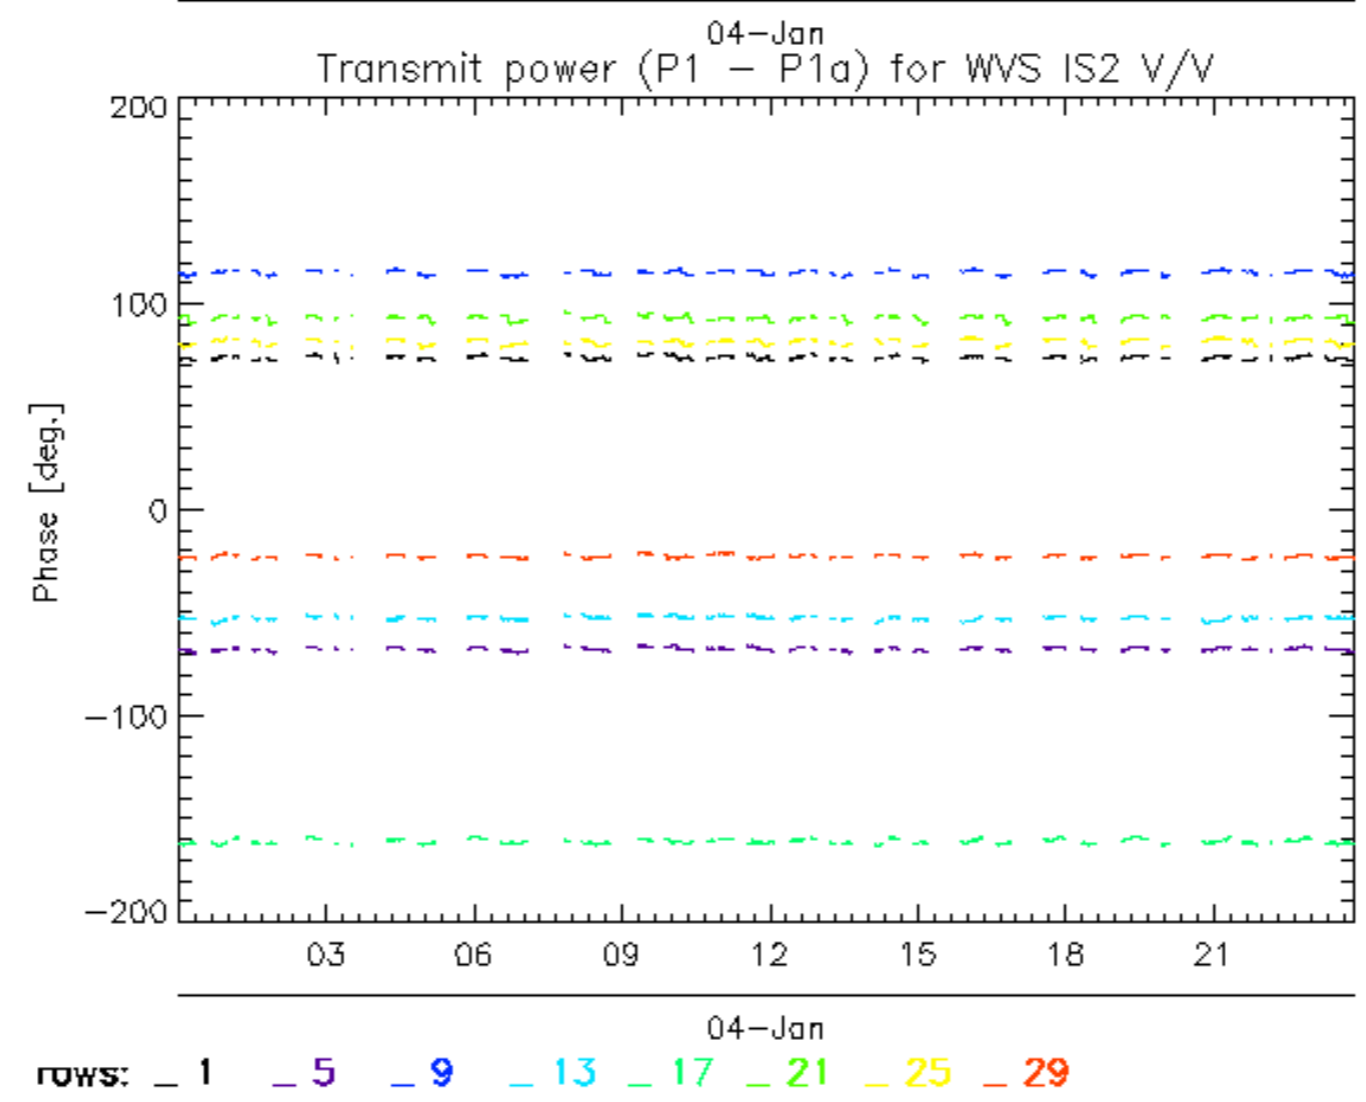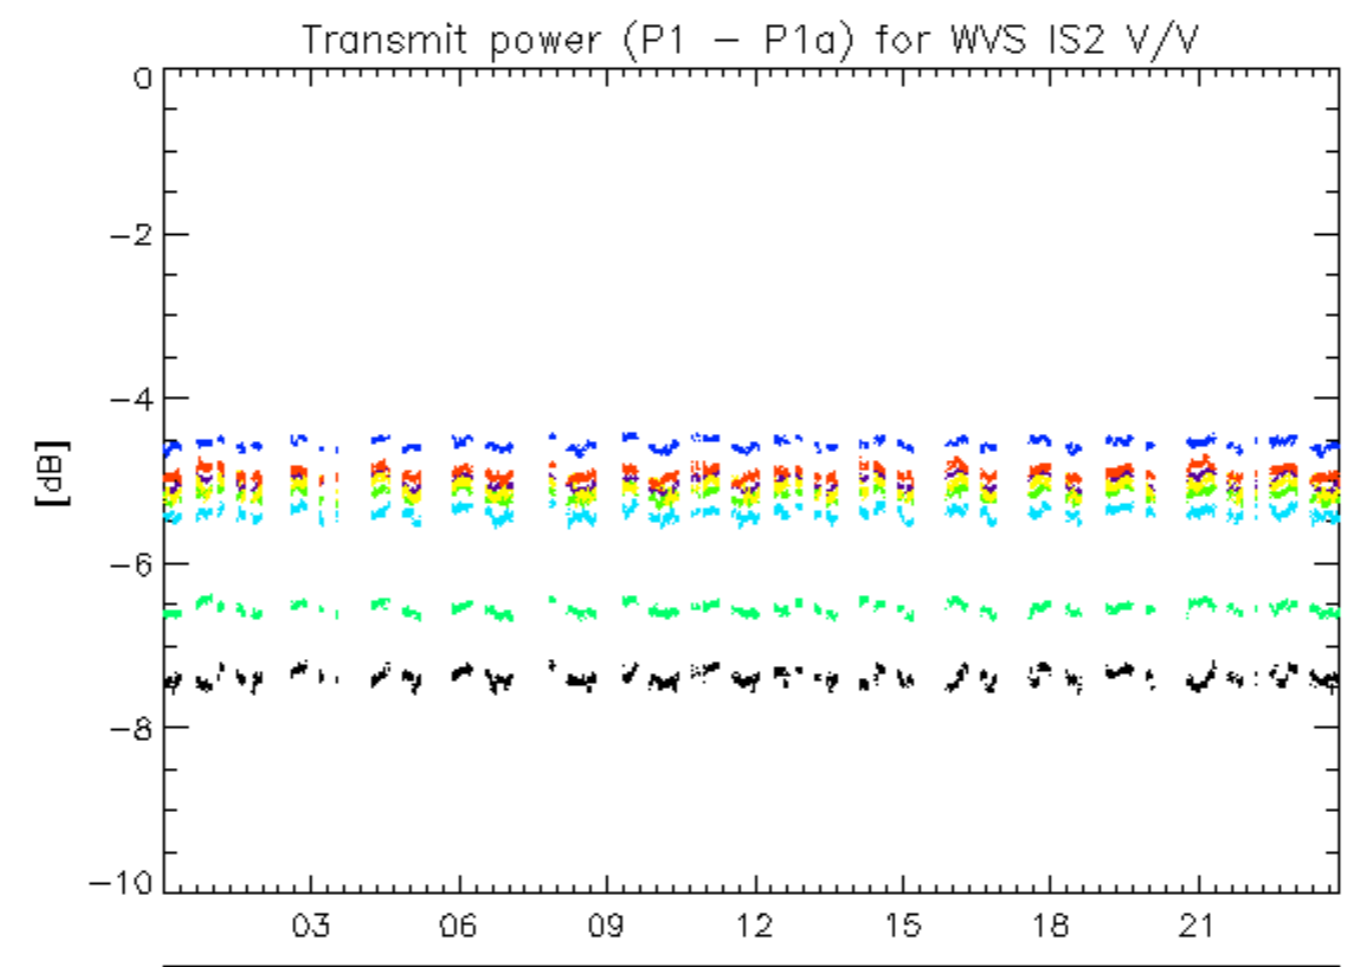


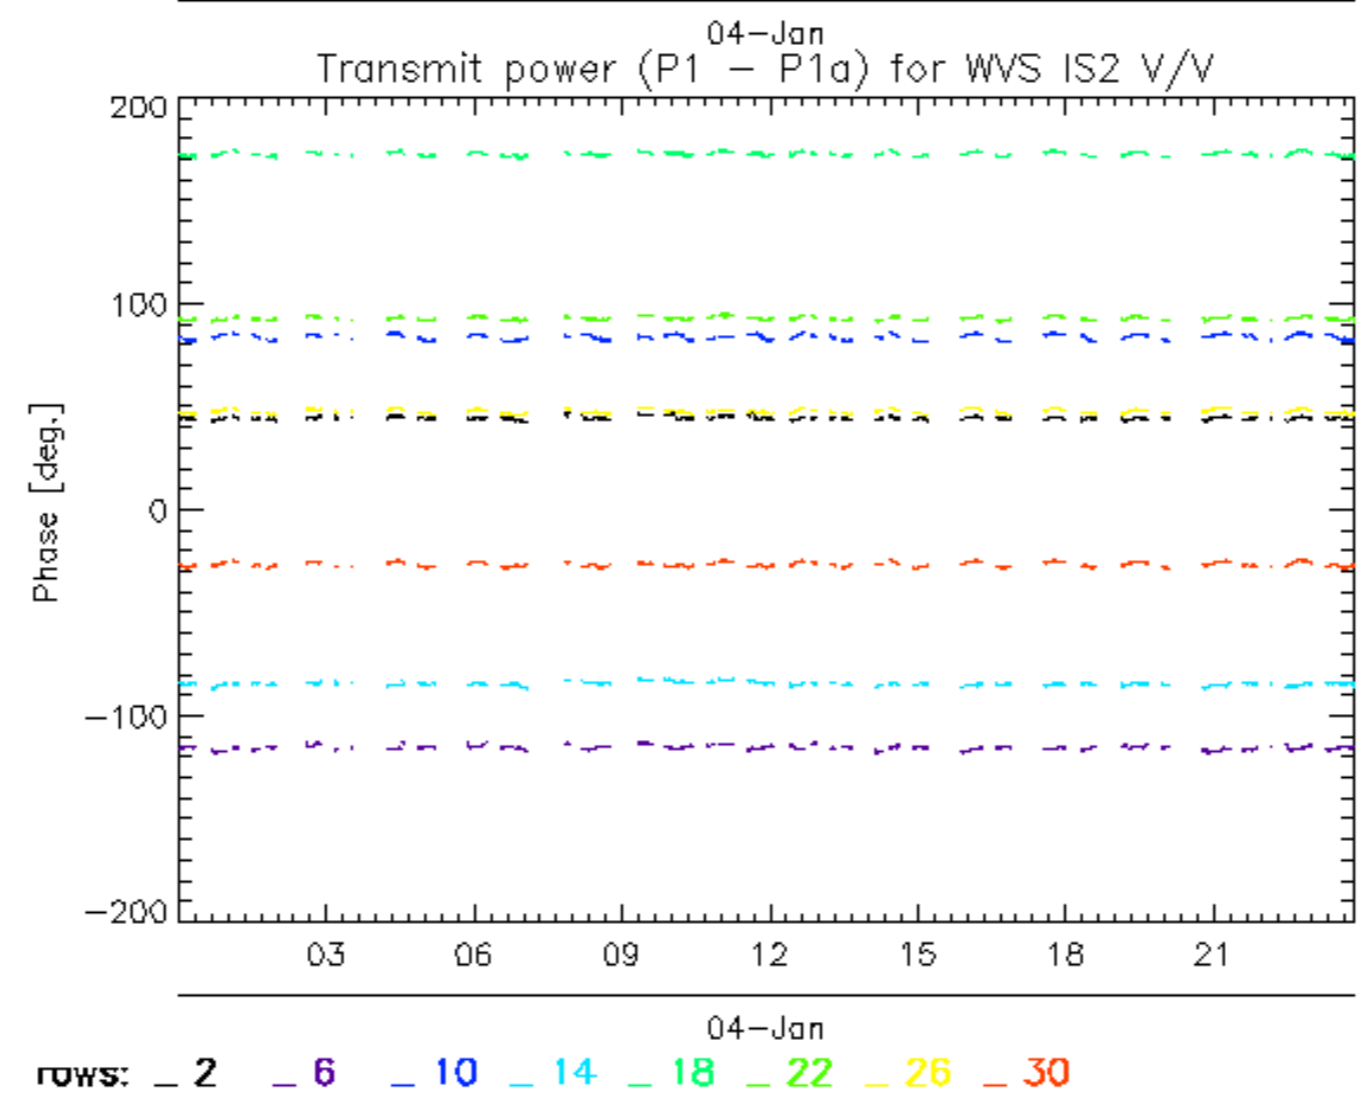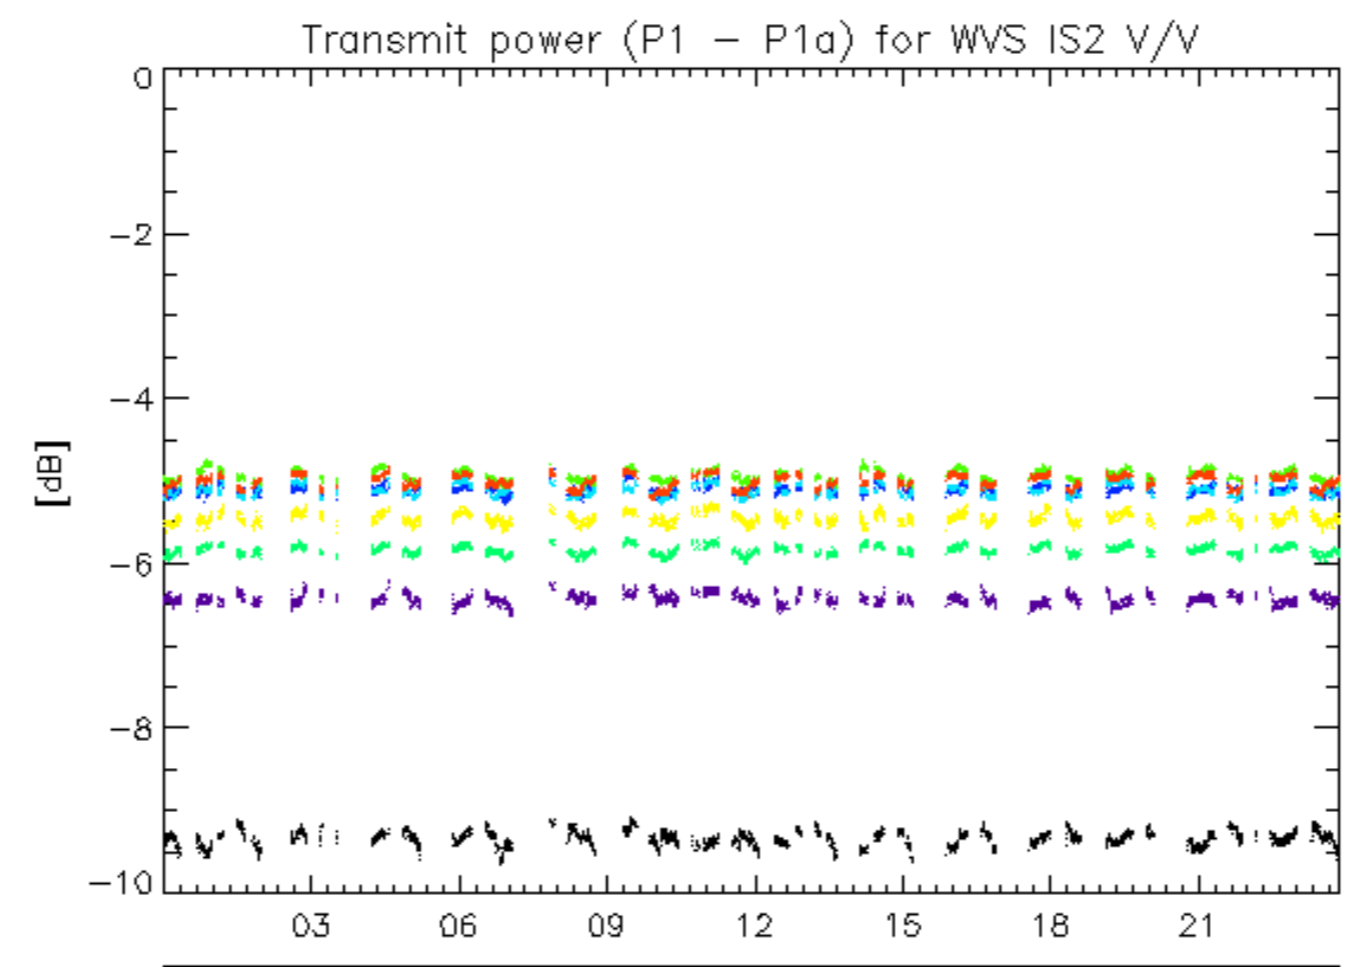


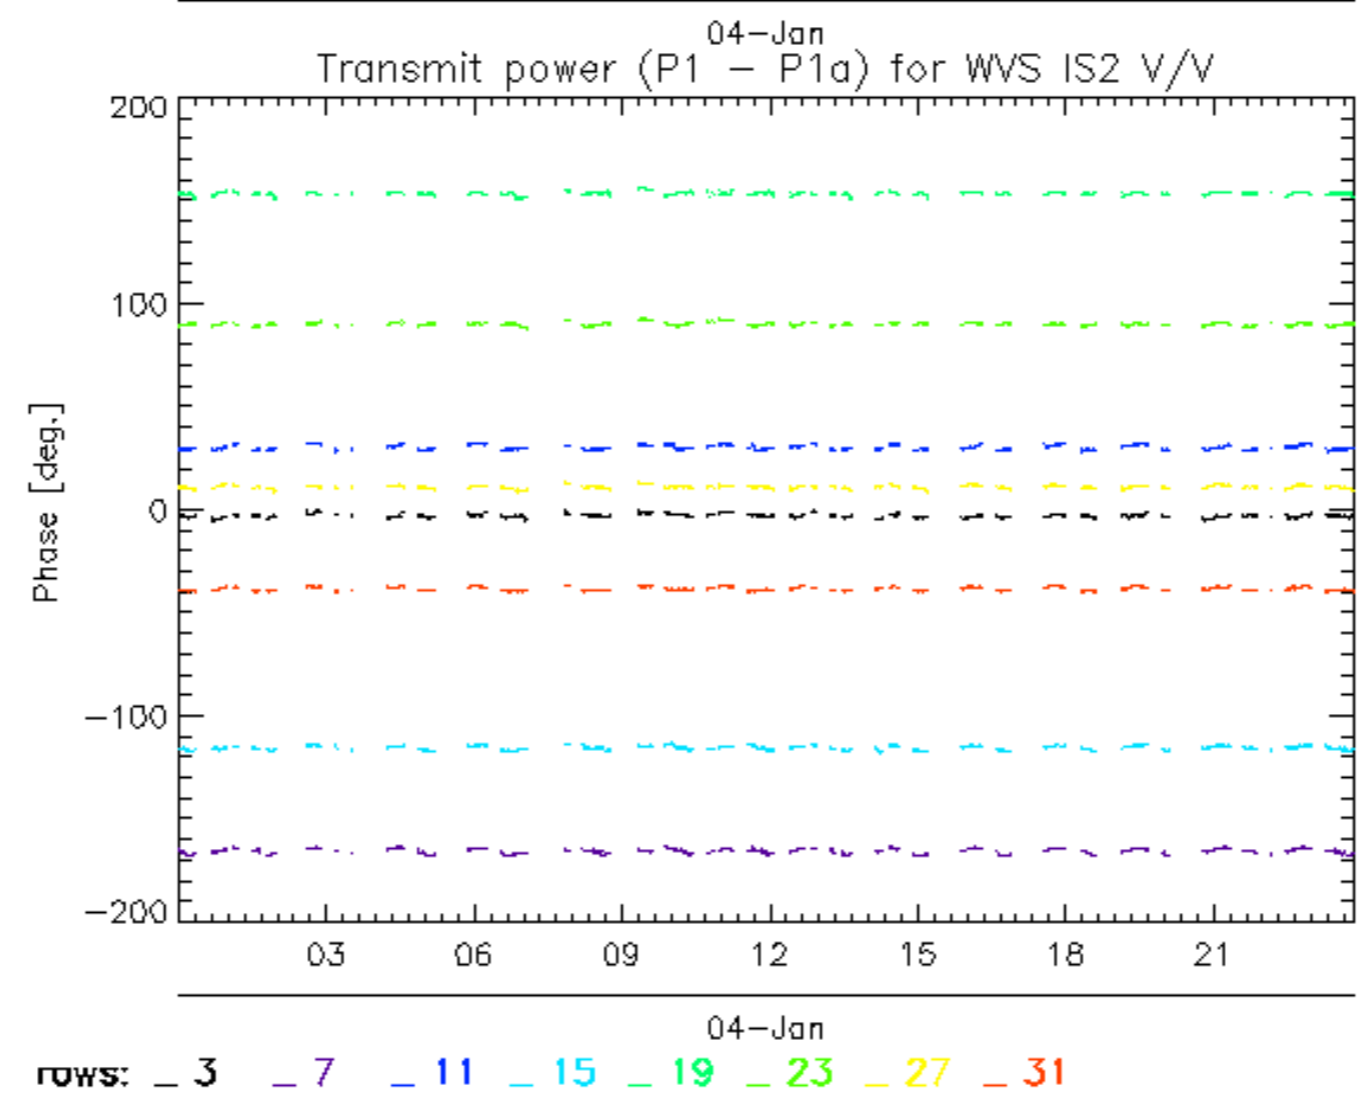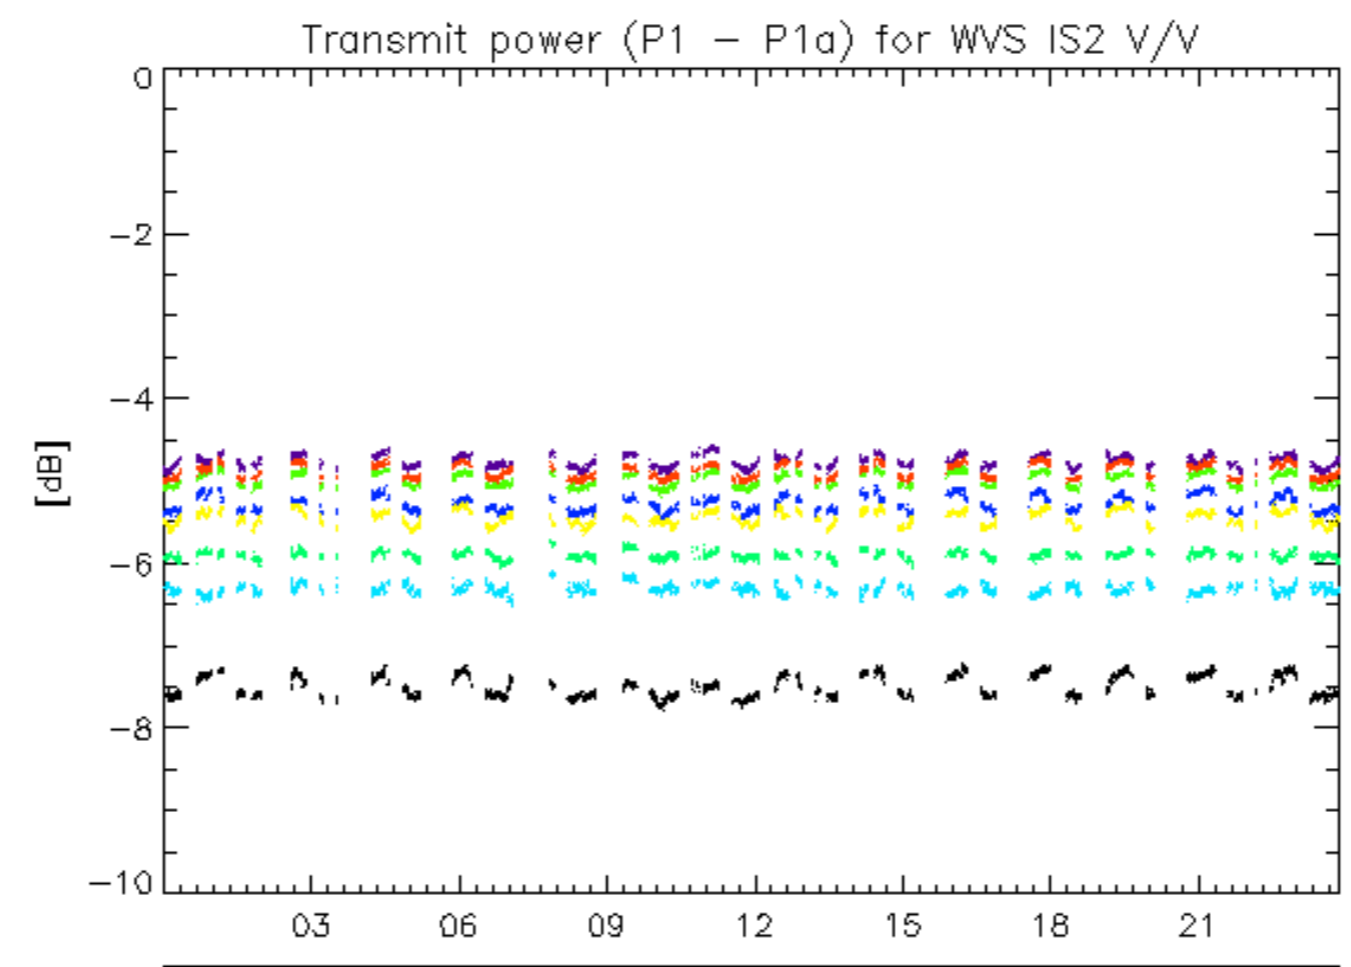


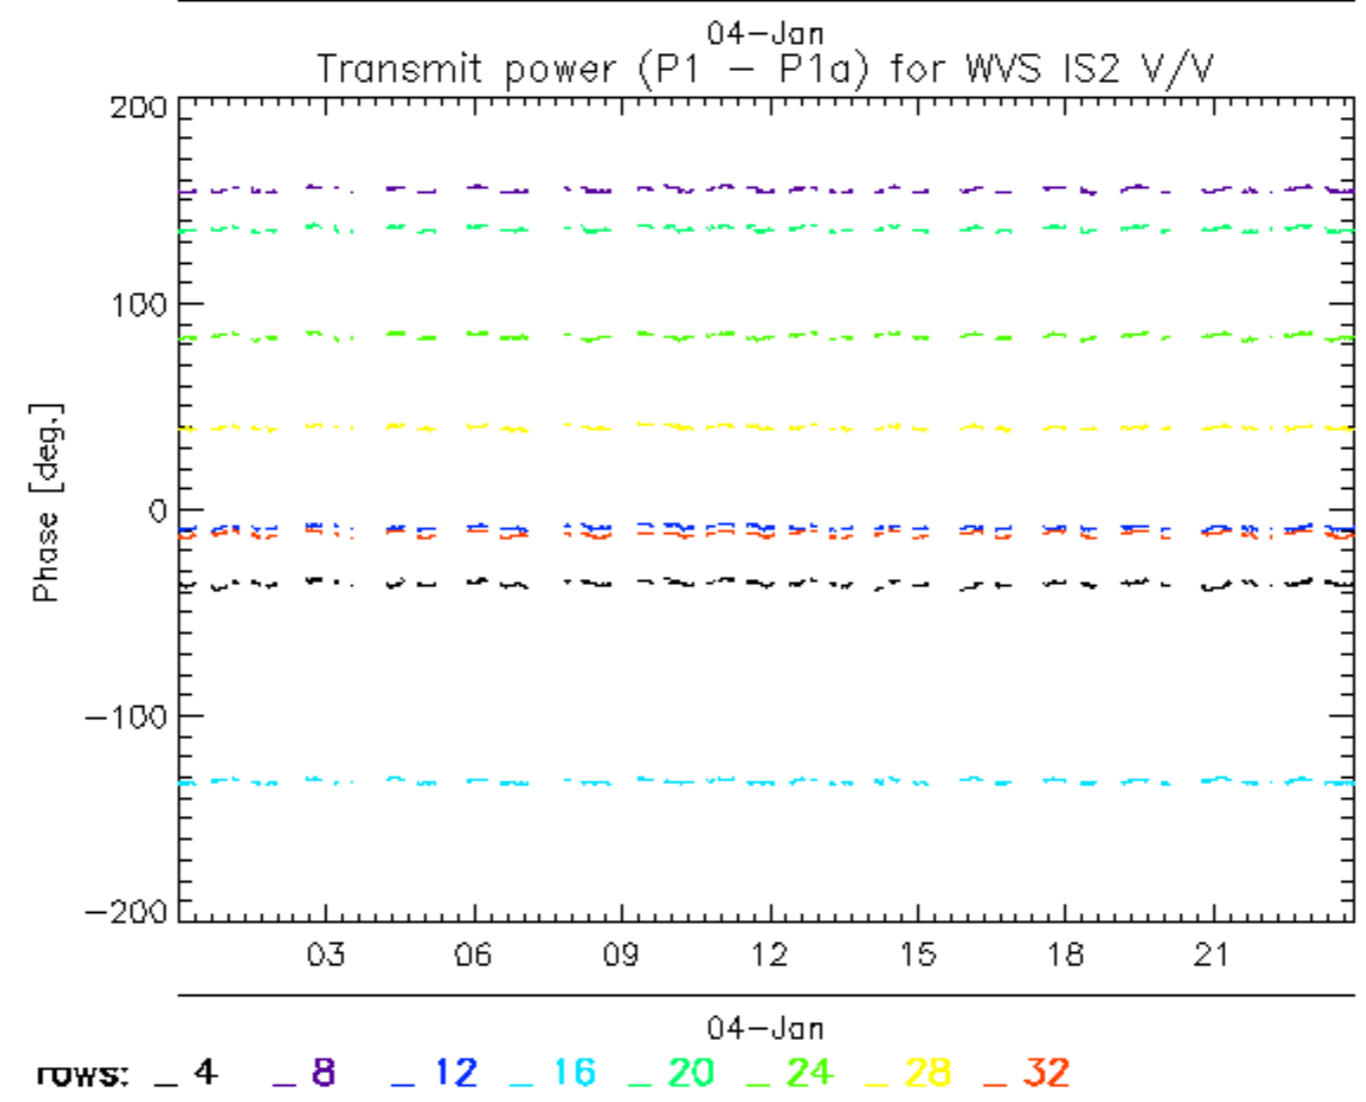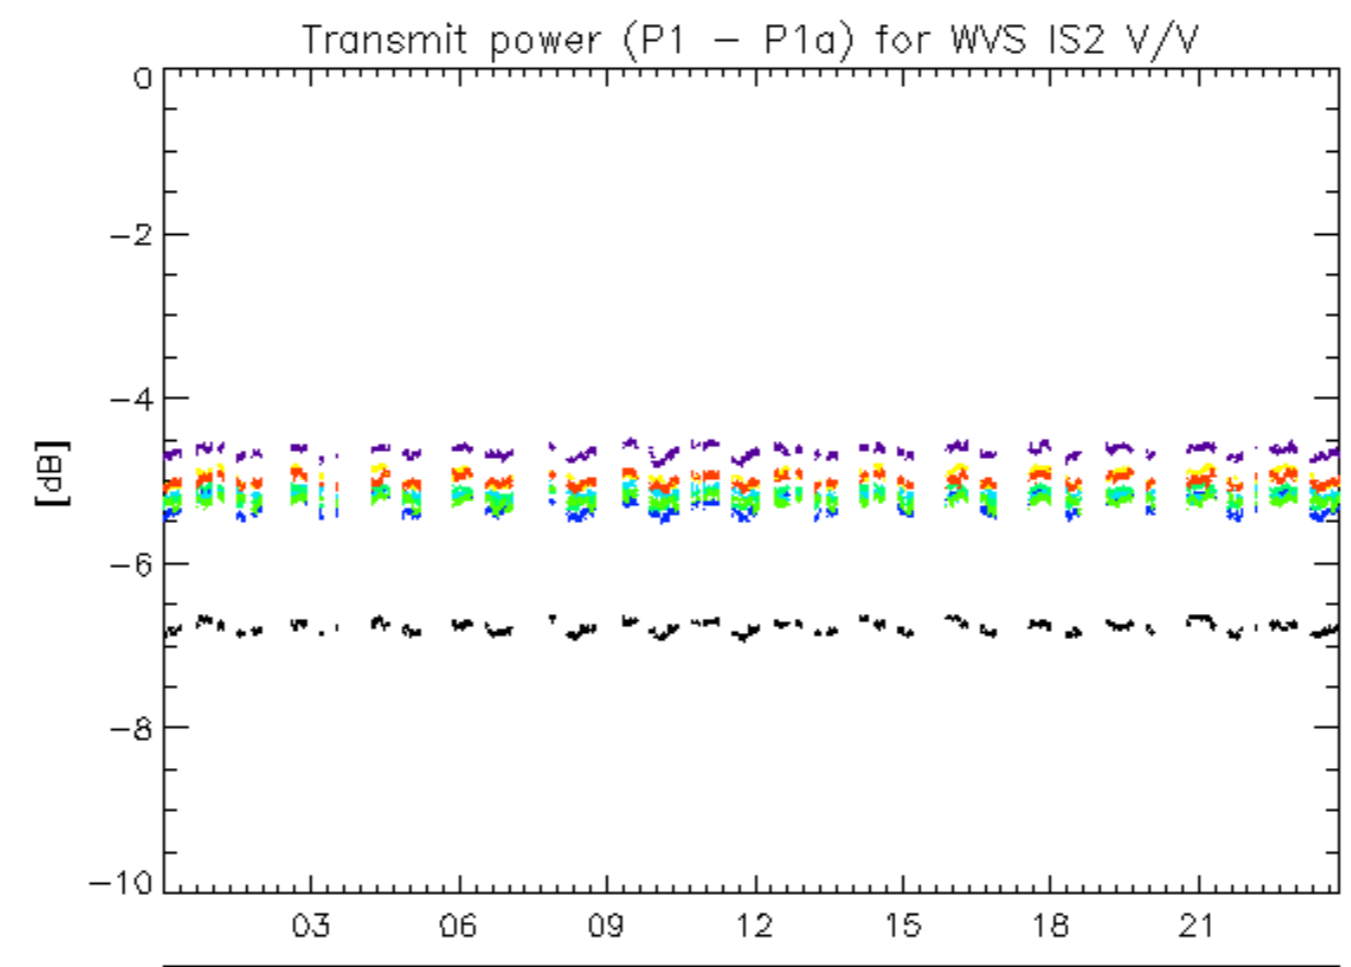

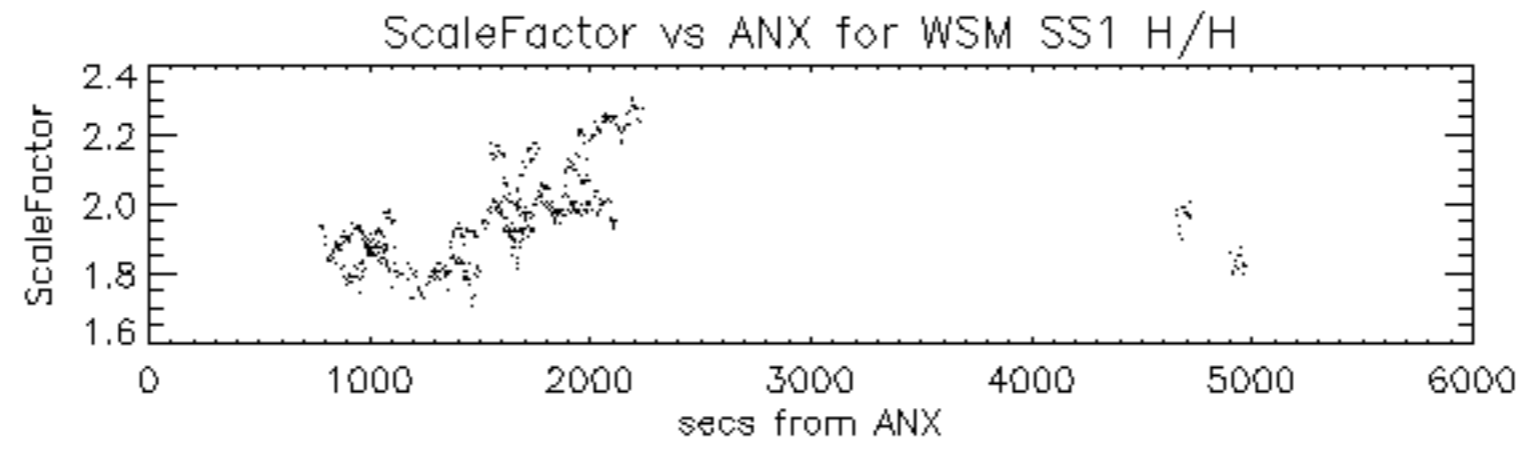

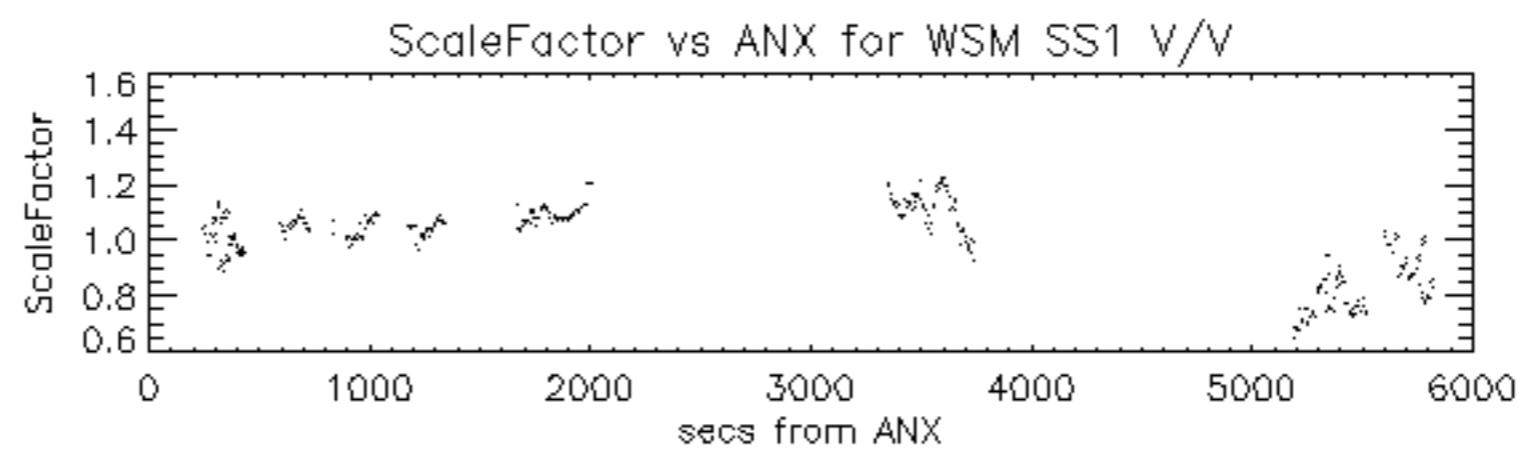

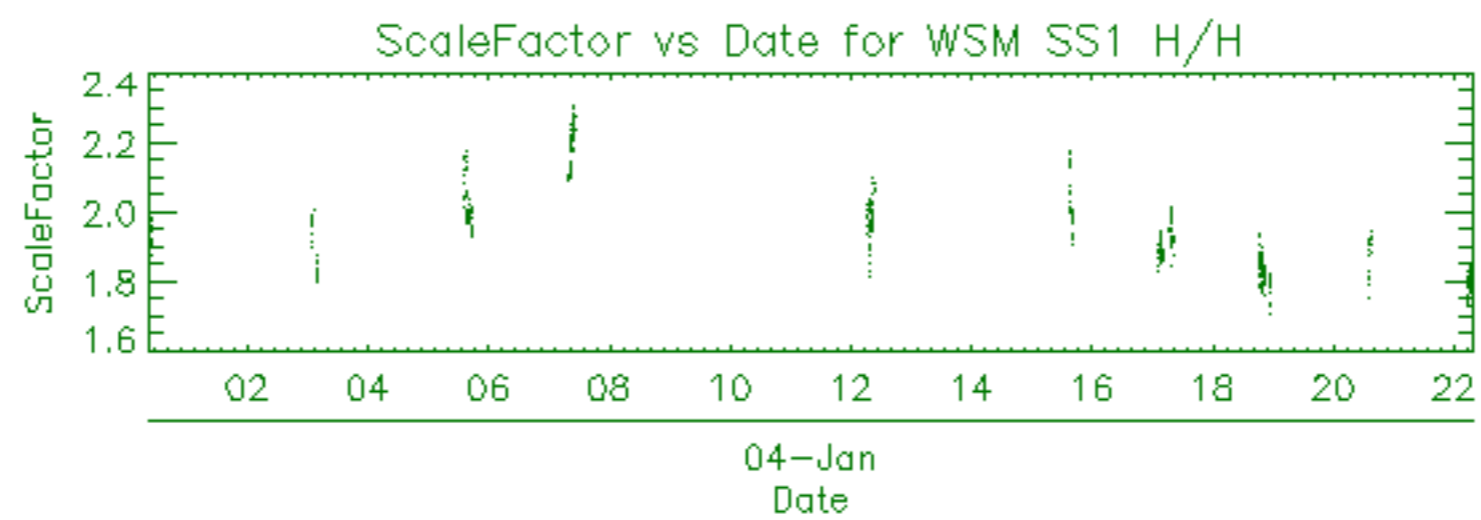

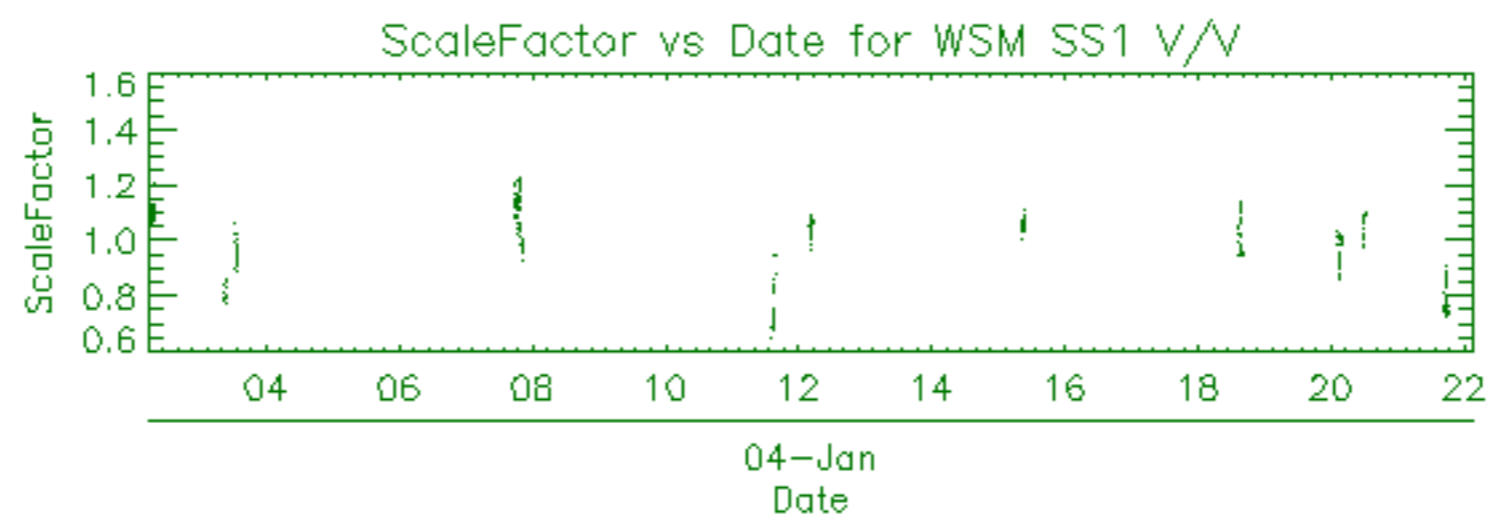

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_APM_1PNPDE20080104_051456_000000402064_00449_30563_3643.N1						IS2	H/H	64	30563	449	4.05
ASA_APM_1PNPDE20080104_073402_000000872064_00450_30564_3813.N1						IS2	H/H	64	30564	450	4.05

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_GM1_1PNPDE20080104_002457_000009002064_00446_30560_3200.N1						SS1	H/H	64	30560	446	4.05
ASA_GM1_1PNPDE20080104_005953_000003802064_00446_30560_3202.N1						SS1	H/H	64	30560	446	4.05
ASA_GM1_1PNPDE20080104_012740_000001082064_00446_30560_3207.N1						SS1	H/H	64	30560	446	4.05
ASA_GM1_1PNPDE20080104_013912_000005372064_00446_30560_3337.N1						SS1	H/H	64	30560	446	4.05
ASA_GM1_1PNPDE20080104_015917_000008942064_00447_30561_3344.N1						SS1	H/H	64	30561	447	4.05
ASA_GM1_1PNPDE20080104_022028_000002952064_00447_30561_3339.N1						SS1	H/H	64	30561	447	4.05
ASA_GM1_1PNPDE20080104_022702_000001992064_00447_30561_3351.N1						SS1	H/H	64	30561	447	4.05
ASA_GM1_1PNPDE20080104_030236_000000842064_00447_30561_3470.N1						SS1	H/H	64	30561	447	4.05
ASA_GM1_1PNPDE20080104_030542_000001442064_00447_30561_3477.N1						SS1	H/H	64	30561	447	4.05
ASA_GM1_1PNPDE20080104_031415_000001812064_00447_30561_3475.N1						SS1	H/H	64	30561	447	4.05
ASA_GM1_1PNPDE20080104_031811_000001502064_00447_30561_3479.N1						SS1	H/H	64	30561	447	4.05
ASA_GM1_1PNPDE20080104_032400_000003622064_00447_30561_3484.N1						SS1	H/H	64	30561	447	4.05
ASA_GM1_1PNPDE20080104_033440_000009242064_00448_30562_3513.N1						SS1	H/H	64	30562	448	4.05
ASA_GM1_1PNPDE20080104_033440_000018252064_00448_30562_3612.N1						SS1	H/H	64	30562	448	4.05
ASA_GM1_1PNPDE20080104_033440_000018612064_00448_30562_3623.N1						SS1	H/H	64	30562	448	4.05
ASA_GM1_1PNPDE20080104_040505_000000362064_00448_30562_3517.N1						SS1	H/H	64	30562	448	4.05
ASA_GM1_1PNPDE20080104_040900_000002112064_00448_30562_3519.N1						SS1	H/H	64	30562	448	4.05
ASA_GM1_1PNPDE20080104_043443_000000662064_00448_30562_3648.N1						SS1	H/H	64	30562	448	4.05
ASA_GM1_1PNPDE20080104_044028_000001442064_00448_30562_3650.N1						SS1	H/H	64	30562	448	4.05
ASA_GM1_1PNPDE20080104_044428_000003682064_00448_30562_3655.N1						SS1	H/H	64	30562	448	4.05
ASA_GM1_1PNPDE20080104_051349_000000662064_00449_30563_3667.N1						SS1	H/H	64	30563	449	4.05
ASA_GM1_1PNPDE20080104_052003_000009182064_00449_30563_3693.N1						SS1	H/H	64	30563	449	4.05
ASA_GM1_1PNPDE20080104_054326_000003562064_00449_30563_3728.N1						SS1	H/H	64	30563	449	4.05
ASA_GM1_1PNPDK20080104_061519_000001082064_00449_30563_7209.N1						SS1	H/H	64	30563	449	4.05
ASA_GM1_1PNPDK20080104_061945_000006882064_00449_30563_7214.N1						SS1	H/H	64	30563	449	4.05
ASA_GM1_1PNPDK20080104_070455_000001632064_00450_30564_7218.N1						SS1	H/H	64	30564	450	4.05
ASA_GM1_1PNPDK20080104_070900_000004412064_00450_30564_7225.N1						SS1	H/H	64	30564	450	4.05
ASA_GM1_1PNPDK20080104_072712_000004102064_00450_30564_7289.N1						SS1	H/H	64	30564	450	4.05
ASA_GM1_1PNPDK20080104_073555_000001872064_00450_30564_7291.N1						SS1	H/H	64	30564	450	4.05
ASA_GM1_1PNPDK20080104_073957_000002472064_00450_30564_7293.N1						SS1	H/H	64	30564	450	4.05
ASA_GM1_1PNPDK20080104_075555_000001142064_00450_30564_7295.N1						SS1	H/H	64	30564	450	4.05
ASA_GM1_1PNPDK20080104_080254_000005372064_00450_30564_7303.N1						SS1	H/H	64	30564	450	4.05
ASA_GM1_1PNPDK20080104_084705_000005012064_00451_30565_7305.N1						SS1	H/H	64	30565	451	4.05
ASA_GM1_1PNPDK20080104_085705_000000842064_00451_30565_7319.N1						SS1	H/H	64	30565	451	4.05
ASA_GM1_1PNPDK20080104_085728_000002772064_00451_30565_7422.N1						SS1	H/H	64	30565	451	4.05
ASA_GM1_1PNPDK20080104_090448_000000962064_00451_30565_7424.N1						SS1	H/H	64	30565	451	4.05
ASA_GM1_1PNPDK20080104_091306_000000722064_00451_30565_7426.N1						SS1	H/H	64	30565	451	4.05
ASA_GM1_1PNPDK20080104_093631_000000962064_00451_30565_7428.N1						SS1	H/H	64	30565	451	4.05
ASA_GM1_1PNPDK20080104_094748_000002772064_00451_30565_7433.N1						SS1	H/H	64	30565	451	4.05
ASA_GM1_1PNPDK20080104_102628_000005432064_00452_30566_7440.N1						SS1	H/H	64	30566	452	4.05
ASA_GM1_1PNPDK20080104_105145_000001992064_00452_30566_7555.N1						SS1	H/H	64	30566	452	4.05
ASA_GM1_1PNPDK20080104_112242_000001442064_00452_30566_7557.N1						SS1	H/H	64	30566	452	4.05
ASA_GM1_1PNPDK20080104_113003_000001812064_00452_30566_7565.N1						SS1	H/H	64	30566	452	4.05
ASA_GM1_1PNPDK20080104_120608_000002112064_00453_30567_7567.N1						SS1	H/H	64	30567	453	4.05
ASA_GM1_1PNPDK20080104_121258_000002112064_00453_30567_7569.N1						SS1	H/H	64	30567	453	4.05
ASA_GM1_1PNPDK20080104_124111_000005672064_00453_30567_7680.N1						SS1	H/H	64	30567	453	4.05
ASA_GM1_1PNPDK20080104_125743_000000722064_00453_30567_7685.N1						SS1	H/H	64	30567	453	4.05
ASA_GM1_1PNPDK20080104_130632_000004282064_00453_30567_7703.N1						SS1	H/H	64	30567	453	4.05
ASA_GM1_1PNPDK20080104_131935_000004652064_00453_30567_7708.N1						SS1	H/H	64	30567	453	4.05
ASA_GM1_1PNPDK20080104_134233_000008332064_00454_30568_7713.N1						SS1	H/H	64	30568	454	4.05
ASA_GM1_1PNPDK20080104_135522_000006942064_00454_30568_7823.N1						SS1	H/H	64	30568	454	4.05
ASA_GM1_1PNPDK20080104_141817_000002772064_00454_30568_7828.N1						SS1	H/H	64	30568	454	4.05
ASA_GM1_1PNPDK20080104_142426_000001022064_00454_30568_7830.N1						SS1	H/H	64	30568	454	4.05
ASA_GM1_1PNPDK20080104_143935_000000782064_00454_30568_7832.N1						SS1	H/H	64	30568	454	4.05
ASA_GM1_1PNPDK20080104_144230_000007062064_00454_30568_7847.N1						SS1	H/H	64	30568	454	4.05
ASA_GM1_1PNPDK20080104_150115_000001872064_00454_30568_7842.N1						SS1	H/H	64	30568	454	4.05
ASA_GM1_1PNPDK20080104_151349_000003382064_00455_30569_7849.N1						SS1	H/H	64	30569	455	4.05
ASA_GM1_1PNPDK20080104_152354_000003682064_00455_30569_7854.N1						SS1	H/H	64	30569	455	4.05
ASA_GM1_1PNPDK20080104_153542_000000782064_00455_30569_7963.N1						SS1	H/H	64	30569	455	4.05
ASA_GM1_1PNPDK20080104_154051_000007672064_00455_30569_7968.N1						SS1	H/H	64	30569	455	4.05
ASA_GM1_1PNPDK20080104_155549_000001262064_00455_30569_7970.N1						SS1	H/H	64	30569	455	4.05
ASA_GM1_1PNPDK20080104_161855_000005132064_00455_30569_7972.N1						SS1	H/H	64	30569	455	4.05
ASA_GM1_1PNPDK20080104_163204_000001692064_00455_30569_7977.N1						SS1	H/H	64	30569	455	4.05
ASA_GM1_1PNPDK20080104_165411_000003742064_00456_30570_7979.N1						SS1	H/H	64	30570	456	4.05
ASA_GM1_1PNPDK20080104_170238_000001872064_00456_30570_7986.N1						SS1	H/H	64	30570	456	4.05
ASA_GM1_1PNPDK20080104_172151_000007552064_00456_30570_8100.N1						SS1	H/H	64	30570	456	4.05
ASA_GM1_1PNPDK20080104_175931_000001872064_00456_30570_8098.N1						SS1	H/H	64	30570	456	4.05

ASA_GM1_1PNPDK20080104_180715_00000842064_00456_30570_8102.N1	SS1	H/H	64	30570	456	4.05
ASA_GM1_1PNPDK20080104_181215_000001932064_00456_30570_8107.N1	SS1	H/H	64	30570	456	4.05
ASA_GM1_1PNPDK20080104_184012_000003082064_00457_30571_8114.N1	SS1	H/H	64	30571	457	4.05
ASA_GM1_1PNPDK20080104_185208_000001142064_00457_30571_8229.N1	SS1	H/H	64	30571	457	4.05
ASA_GM1_1PNPDK20080104_190022_000003142064_00457_30571_8231.N1	SS1	H/H	64	30571	457	4.05
ASA_GM1_1PNPDK20080104_194007_000001572064_00457_30571_8233.N1	SS1	H/H	64	30571	457	4.05
ASA_GM1_1PNPDK20080104_194920_000004042064_00457_30571_8238.N1	SS1	H/H	64	30571	457	4.05
ASA_GM1_1PNPDK20080104_200926_000007252064_00457_30571_8240.N1	SS1	H/H	64	30571	457	4.05
ASA_GM1_1PNPDK20080104_202530_000001442064_00458_30572_8250.N1	SS1	H/H	64	30572	458	4.05
ASA_GM1_1PNPDE20080104_203058_000002352064_00458_30572_4126.N1	SS1	H/H	64	30572	458	4.05
ASA_GM1_1PNPDE20080104_203752_000005672064_00458_30572_4128.N1	SS1	H/H	64	30572	458	4.05
ASA_GM1_1PNPDE20080104_212042_000001142064_00458_30572_4132.N1	SS1	H/H	64	30572	458	4.05
ASA_GM1_1PNPDE20080104_212617_00000842064_00458_30572_4130.N1	SS1	H/H	64	30572	458	4.05
ASA_GM1_1PNPDE20080104_213443_000001142064_00458_30572_4142.N1	SS1	H/H	64	30572	458	4.05
ASA_GM1_1PNPDE20080104_215446_000006702064_00459_30573_4282.N1	SS1	H/H	64	30573	459	4.05
ASA_GM1_1PNPDE20080104_221857_000004532064_00459_30573_4284.N1	SS1	H/H	64	30573	459	4.05
ASA_GM1_1PNPDE20080104_231442_000001502064_00459_30573_4292.N1	SS1	H/H	64	30573	459	4.05
ASA_GM1_1PNPDE20080104_235320_00000842064_00460_30574_4424.N1	SS1	H/H	64	30574	460	4.05
ASA_GM1_1PNPDE20080104_235620_000008032064_00460_30574_4429.N1	SS1	H/H	64	30574	460	4.05

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20080104_011416_000003012064_00446_30560_3320.N1						IS2	H/H	64	30560	446	4.05
ASA_IMM_1PNPDE20080104_011416_000005602064_00446_30560_3598.N1						IS2	H/H	64	30560	446	4.05
ASA_IMM_1PNPDE20080104_012018_000000592064_00446_30560_3309.N1						IS2	H/H	64	30560	446	4.05
ASA_IMM_1PNPDE20080104_012218_000000782064_00446_30560_3321.N1						IS2	H/H	64	30560	446	4.05
ASA_IMM_1PNPDE20080104_012416_000001872064_00446_30560_3295.N1						IS2	H/H	64	30560	446	4.05
ASA_IMM_1PNPDE20080104_022524_000000812064_00447_30561_3403.N1						IS2	V/V	64	30561	447	4.05
ASA_IMM_1PNPDE20080104_023054_000000822064_00447_30561_3596.N1						IS2	V/V	64	30561	447	4.05
ASA_IMM_1PNPDE20080104_023157_000000192064_00447_30561_3326.N1						IS2	V/V	64	30561	447	4.05
ASA_IMM_1PNPDE20080104_025459_000004392064_00447_30561_3602.N1						IS2	H/H	64	30561	447	4.05
ASA_IMM_1PNPDE20080104_025700_000003192064_00447_30561_3442.N1						IS2	H/H	64	30561	447	4.05
ASA_IMM_1PNPDE20080104_031719_000000362064_00447_30561_3450.N1						IS4	V/V	64	30561	447	4.05
ASA_IMM_1PNPDE20080104_040544_000000622064_00448_30562_3464.N1						IS2	V/V	64	30562	448	4.05
ASA_IMM_1PNPDE20080104_040544_000001802064_00448_30562_3610.N1						IS2	V/V	64	30562	448	4.05
ASA_IMM_1PNPDE20080104_040745_000000592064_00448_30562_3468.N1						IS2	V/V	64	30562	448	4.05
ASA_IMM_1PNPDE20080104_043551_000002602064_00448_30562_3592.N1						IS2	H/H	64	30562	448	4.05
ASA_IMM_1PNPDE20080104_044251_000000802064_00448_30562_3700.N1						IS2	H/H	64	30562	448	4.05
ASA_IMM_1PNPDE20080104_051610_000002152064_00449_30563_3777.N1						IS2	V/V	64	30563	449	4.05
ASA_IMM_1PNPDE20080104_054920_000001372064_00449_30563_3698.N1						IS2	V/V	64	30563	449	4.05
ASA_IMM_1PNPDE20080104_061708_000001402064_00449_30563_3783.N1						IS2	H/H	64	30563	449	4.05
ASA_IMM_1PNPDE20080104_061810_000000782064_00449_30563_3775.N1						IS2	H/H	64	30563	449	4.05
ASA_IMM_1PNPDK20080104_070739_000000622064_00450_30564_7216.N1						IS2	V/V	64	30564	450	4.05
ASA_IMM_1PNPDK20080104_071622_000001572064_00450_30564_7272.N1						IS2	V/V	64	30564	450	4.05
ASA_IMM_1PNPDE20080104_072620_000000352064_00450_30564_3803.N1						IS5	V/V	64	30564	450	4.05
ASA_IMM_1PNPDE20080104_073904_000000352064_00450_30564_3809.N1						IS7	V/V	64	30564	450	4.05
ASA_IMM_1PNPDE20080104_091418_000002632064_00451_30565_3857.N1						IS2	V/V	64	30565	451	4.05
ASA_IMM_1PNPDE20080104_093811_000003012064_00451_30565_3914.N1						IS2	H/H	64	30565	451	4.05
ASA_IMM_1PNPDE20080104_093811_000005602064_00451_30565_3918.N1						IS2	H/H	64	30565	451	4.05
ASA_IMM_1PNPDE20080104_094512_000001392064_00451_30565_3915.N1						IS2	H/H	64	30565	451	4.05
ASA_IMM_1PNPDE20080104_105506_000000982064_00452_30566_3878.N1						IS3	H/H	64	30566	452	4.05
ASA_IMM_1PNPDE20080104_111805_000002602064_00452_30566_3912.N1						IS2	H/H	64	30566	452	4.05
ASA_IMM_1PNPDE20080104_112505_000002812064_00452_30566_3946.N1						IS2	H/H	64	30566	452	4.05
ASA_IMM_1PNPDK20080104_125854_000004412064_00453_30567_7812.N1						IS2	H/H	64	30567	453	4.05
ASA_IMM_1PNPDK20080104_132910_000000352064_00453_30567_7786.N1						IS6	V/V	64	30567	453	4.05
ASA_IMM_1PNPDK20080104_134010_000001252064_00454_30568_7794.N1						IS1	V/V	64	30568	454	4.05
ASA_IMM_1PNPDE20080104_142254_000000752064_00454_30568_4012.N1						IS4	H/H	64	30568	454	4.05
ASA_IMM_1PNPDE20080104_144052_000000802064_00454_30568_4008.N1						IS2	H/H	64	30568	454	4.05
ASA_IMM_1PNPDE20080104_151927_000000352064_00455_30569_3996.N1						IS7	H/H	64	30569	455	4.05
ASA_IMM_1PNPDK20080104_153003_000001402064_00455_30569_7937.N1						IS2	V/V	64	30569	455	4.05
ASA_IMM_1PNPDK20080104_153334_000001102064_00455_30569_7947.N1						IS2	V/V	64	30569	455	4.05
ASA_IMM_1PNPDE20080104_162726_000000622064_00455_30569_3998.N1						IS2	H/H	64	30569	455	4.05
ASA_IMM_1PNPDE20080104_162726_000002602064_00455_30569_4024.N1						IS2	H/H	64	30569	455	4.05
ASA_IMM_1PNPDE20080104_162928_000001372064_00455_30569_4010.N1						IS2	H/H	64	30569	455	4.05
ASA_IMM_1PNPDE20080104_170025_000001152064_00456_30570_4036.N1						IS6	V/V	64	30570	456	4.05
ASA_IMM_1PNPDK20080104_171124_000002622064_00456_30570_8079.N1						IS2	V/V	64	30570	456	4.05
ASA_IMM_1PNPDE20080104_172057_000000382064_00456_30570_4044.N1						IS4	V/V	64	30570	456	4.05
ASA_IMM_1PNPDE20080104_180237_000002602064_00456_30570_4072.N1						IS2	H/H	64	30570	456	4.05
ASA_IMM_1PNPDE20080104_180837_000001992064_00456_30570_4054.N1						IS2	H/H	64	30570	456	4.05
ASA_IMM_1PNPDK20080104_185401_000001122064_00457_30571_8193.N1						IS2	V/V	64	30571	457	4.05
ASA_IMM_1PNPDE20080104_185813_000001122064_00457_30571_4078.N1						IS2	H/H	64	30571	457	4.05
ASA_IMM_1PNPDE20080104_190536_000001062064_00457_30571_4092.N1						IS2	V/V	64	30571	457	4.05
ASA_IMM_1PNPDE20080104_194242_000002602064_00457_30571_4114.N1						IS2	H/H	64	30571	457	4.05
ASA_IMM_1PNPDE20080104_194742_000000802064_00457_30571_4120.N1						IS2	H/H	64	30571	457	4.05
ASA_IMM_1PNPDE20080104_194844_000000182064_00457_30571_4082.N1						IS2	***	64	30571	457	4.05
ASA_IMM_1PNPDE20080104_212239_000001992064_00458_30572_4244.N1						IS2	H/H	64	30572	458	4.05
ASA_IMM_1PNPDE20080104_212739_000001212064_00458_30572_4249.N1						IS2	H/H	64	30572	458	4.05
ASA_IMM_1PNPDE20080104_212739_000004052064_00458_30572_4263.N1						IS2	H/H	64	30572	458	4.05
ASA_IMM_1PNPDE20080104_213041_000000592064_00458_30572_4228.N1						IS2	H/H	64	30572	458	4.05
ASA_IMM_1PNPDE20080104_213241_000001032064_00458_30572_4250.N1						IS2	H/H	64	30572	458	4.05
ASA_IMM_1PNPDK20080104_220809_000000982064_00459_30573_8370.N1						IS2	V/V	64	30573	459	4.05
ASA_IMM_1PNPDK20080104_221142_000000662064_00459_30573_8368.N1						IS2	H/H	64	30573	459	4.05
ASA_IMM_1PNPDE20080104_222742_000000362064_00459_30573_4366.N1						IS1	V/V	64	30573	459	4.05
ASA_IMM_1PNPDE20080104_230222_000001812064_00459_30573_4396.N1						IS2	H/H	64	30573	459	4.05
ASA_IMM_1PNPDE20080104_230222_000001992064_00459_30573_4411.N1						IS2	H/H	64	30573	459	4.05
ASA_IMM_1PNPDE20080104_230622_000000622064_00459_30573_4380.N1						IS2	H/H	64	30573	459	4.05
ASA_IMM_1PNPDE20080104_230622_000004802064_00459_30573_4413.N1						IS2	H/H	64	30573	459	4.05
ASA_IMM_1PNPDE20080104_230823_000003602064_00459_30573_4406.N1						IS2	H/H	64	30573	459	4.05
ASA_IMM_1PNPDE20080104_233754_000000852064_00460_30574_4530.N1						IS2	V/V	64	30574	460	4.05

ASA_IMM_1PNPDE20080104_235142_00000802064_00460_30574_4532.N1	IS2	H/H	64	30574	460	4.05
ASA_IMM_1PNPDK20080104_235442_00000812064_00460_30574_8388.N1	IS2	H/H	64	30574	460	4.05





Filename	Pol	Timestamp	count(Module)
ASA_MS__0PNPDK20080104_143811_000000162064_00454_30568_0449.N1	H	2008-01-04 14:38:11	320





Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WSM_1PNPDE20080104_002157_000000672064_00446_30560_3289.N1						SS1	H/H	64	30560	446	4.05
ASA_WSM_1PNPDE20080104_002157_000001712064_00446_30560_3614.N1						SS1	H/H	64	30560	446	4.05
ASA_WSM_1PNPDE20080104_002406_000000422064_00446_30560_3293.N1						SS1	H/H	64	30560	446	4.05
ASA_WSM_1PNPDE20080104_021423_000000672064_00447_30561_3405.N1						SS1	V/V	64	30561	447	4.05
ASA_WSM_1PNPDE20080104_021423_000003542064_00447_30561_3621.N1						SS1	V/V	64	30561	447	4.05
ASA_WSM_1PNPDE20080104_021632_000002252064_00447_30561_3448.N1						SS1	V/V	64	30561	447	4.05
ASA_WSM_1PNPDE20080104_030408_000000852064_00447_30561_3619.N1						SS1	H/H	64	30561	447	4.05
ASA_WSM_1PNPDE20080104_030515_000000182064_00447_30561_3446.N1						SS1	H/H	64	30561	447	4.05
ASA_WSM_1PNPDE20080104_030818_000000852064_00447_30561_3524.N1						SS1	H/H	64	30561	447	4.05
ASA_WSM_1PNPDE20080104_032234_000000672064_00447_30561_3456.N1						SS1	V/V	64	30561	447	4.05
ASA_WSM_1PNPDE20080104_033205_000001472064_00448_30562_3574.N1						SS1	V/V	64	30562	448	4.05
ASA_WSM_1PNPDK20080104_053533_000002322064_00449_30563_7207.N1						SS1	H/H	64	30563	449	4.05
ASA_WSM_1PNPDE20080104_053845_000001282064_00449_30563_3779.N1						SS1	H/H	64	30563	449	4.05
ASA_WSM_1PNPDE20080104_053845_000002692064_00449_30563_3788.N1						SS1	H/H	64	30563	449	4.05
ASA_WSM_1PNPDE20080104_054148_000000862064_00449_30563_3780.N1						SS1	H/H	64	30563	449	4.05
ASA_WSM_1PNPDK20080104_071946_000002752064_00450_30564_7287.N1						SS1	H/H	64	30564	450	4.05
ASA_WSM_1PNPDE20080104_072342_000001282064_00450_30564_3815.N1						SS1	H/H	64	30564	450	4.05
ASA_WSM_1PNPDE20080104_074412_000003672064_00450_30564_3836.N1						SS1	V/V	64	30564	450	4.05
ASA_WSM_1PNPDE20080104_074412_000004092064_00450_30564_3839.N1						SS1	V/V	64	30564	450	4.05
ASA_WSM_1PNPDE20080104_113558_000000672064_00452_30566_3940.N1						SS1	V/V	64	30566	452	4.05
ASA_WSM_1PNPDE20080104_113558_000001772064_00452_30566_3948.N1						SS1	V/V	64	30566	452	4.05
ASA_WSM_1PNPDE20080104_113807_000000482064_00452_30566_3944.N1						SS1	V/V	64	30566	452	4.05
ASA_WSM_1PNPDE20080104_120950_000001762064_00453_30567_3928.N1						SS1	V/V	64	30567	453	4.05
ASA_WSM_1PNPDK20080104_121640_000004222064_00453_30567_7672.N1						SS1	H/H	64	30567	453	4.05
ASA_WSM_1PNPDE20080104_152119_000001472064_00455_30569_4038.N1						SS1	V/V	64	30569	455	4.05
ASA_WSM_1PNPDK20080104_153710_000002142064_00455_30569_7961.N1						SS1	H/H	64	30569	455	4.05
ASA_WSM_1PNPDE20080104_170553_000001282064_00456_30570_4042.N1						SS1	H/H	64	30570	456	4.05
ASA_WSM_1PNPDE20080104_170553_000001402064_00456_30570_4118.N1						SS1	H/H	64	30570	456	4.05
ASA_WSM_1PNPDK20080104_170748_000001472064_00456_30570_8091.N1						SS1	H/H	64	30570	456	4.05
ASA_WSM_1PNPDK20080104_171706_000001582064_00456_30570_8096.N1						SS1	H/H	64	30570	456	4.05
ASA_WSM_1PNPDE20080104_171908_000000852064_00456_30570_4040.N1						SS1	H/H	64	30570	456	4.05
ASA_WSM_1PNPDE20080104_183638_000000852064_00457_30571_4112.N1						SS1	V/V	64	30571	457	4.05
ASA_WSM_1PNPDE20080104_183733_000000672064_00457_30571_4066.N1						SS1	V/V	64	30571	457	4.05
ASA_WSM_1PNPDE20080104_183733_000001472064_00457_30571_4124.N1						SS1	V/V	64	30571	457	4.05
ASA_WSM_1PNPDE20080104_183942_000000182064_00457_30571_4070.N1						SS1	V/V	64	30571	457	4.05
ASA_WSM_1PNPDK20080104_184533_000003852064_00457_30571_8227.N1						SS1	H/H	64	30571	457	4.05
ASA_WSM_1PNPDK20080104_185626_000000852064_00457_30571_8225.N1						SS1	H/H	64	30571	457	4.05
ASA_WSM_1PNPDE20080104_200552_000002012064_00457_30571_4122.N1						SS1	V/V	64	30571	457	4.05
ASA_WSM_1PNPDE20080104_200659_000001332064_00457_30571_4116.N1						SS1	V/V	64	30571	457	4.05
ASA_WSM_1PNPDK20080104_202803_000001642064_00458_30572_8345.N1						SS1	V/V	64	30572	458	4.05
ASA_WSM_1PNPDK20080104_203503_000001582064_00458_30572_8356.N1						SS1	H/H	64	30572	458	4.05
ASA_WSM_1PNPDE20080104_214159_000002012064_00458_30572_4265.N1						SS1	V/V	64	30572	458	4.05
ASA_WSM_1PNPDK20080104_220739_000000242064_00459_30573_8358.N1						SS1	V/V	64	30573	459	4.05
ASA_WSM_1PNPDK20080104_221317_000000672064_00459_30573_8372.N1						SS1	H/H	64	30573	459	4.05
ASA_WSM_1PNPDK20080104_221317_000002792064_00459_30573_8390.N1						SS1	H/H	64	30573	459	4.05
ASA_WSM_1PNPDK20080104_221525_000001512064_00459_30573_8382.N1						SS1	H/H	64	30573	459	4.05
ASA_WSM_1PNPDE20080104_221715_000000912064_00459_30573_4404.N1						SS1	H/H	64	30573	459	4.05




Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20080103_235409_000016192064_00445_30559_3192.N1						IS2	V/V	64	30559	445	4.05
ASA_WVS_1PNPDE20080104_003959_000011412064_00446_30560_3198.N1						IS2	V/V	64	30560	446	4.05
ASA_WVS_1PNPDE20080104_010617_000003902064_00446_30560_3195.N1						IS2	V/V	64	30560	446	4.05
ASA_WVS_1PNPDE20080104_012930_000001952064_00446_30560_3205.N1						IS2	V/V	64	30560	446	4.05
ASA_WVS_1PNPDE20080104_013200_000003902064_00446_30560_3335.N1						IS2	V/V	64	30560	446	4.05
ASA_WVS_1PNPDE20080104_014810_000006142064_00447_30561_3342.N1						IS2	V/V	64	30561	447	4.05
ASA_WVS_1PNPDE20080104_023508_000007942064_00447_30561_3354.N1						IS2	V/V	64	30561	447	4.05
ASA_WVS_1PNPDE20080104_024807_000003152064_00447_30561_3473.N1						IS2	V/V	64	30561	447	4.05
ASA_WVS_1PNPDE20080104_030956_000002102064_00447_30561_3482.N1						IS2	V/V	64	30561	447	4.05
ASA_WVS_1PNPDE20080104_033012_000000592064_00448_30562_3511.N1						IS2	V/V	64	30562	448	4.05
ASA_WVS_1PNPDE20080104_041236_000009592064_00448_30562_3522.N1						IS2	V/V	64	30562	448	4.05
ASA_WVS_1PNPDE20080104_042821_000001052064_00448_30562_3646.N1						IS2	V/V	64	30562	448	4.05
ASA_WVS_1PNPDE20080104_043236_000000752064_00448_30562_3653.N1						IS2	V/V	64	30562	448	4.05
ASA_WVS_1PNPDE20080104_045041_000013342064_00448_30562_3696.N1						IS2	V/V	64	30562	448	4.05
ASA_WVS_1PNPDE20080104_055211_000010192064_00449_30563_3767.N1						IS2	V/V	64	30563	449	4.05
ASA_WVS_1PNPDK20080104_060856_000003302064_00449_30563_7212.N1						IS2	V/V	64	30563	449	4.05
ASA_WVS_1PNPDK20080104_063118_000019642064_00449_30563_7228.N1						IS2	V/V	64	30563	449	4.05
ASA_WVS_1PNPDK20080104_075100_000002402064_00450_30564_7298.N1						IS2	V/V	64	30564	450	4.05
ASA_WVS_1PNPDK20080104_081153_000012742064_00450_30564_7301.N1						IS2	V/V	64	30564	450	4.05
ASA_WVS_1PNPDK20080104_083455_000006742064_00451_30565_7308.N1						IS2	V/V	64	30565	451	4.05
ASA_WVS_1PNPDK20080104_091847_000010192064_00451_30565_7431.N1						IS2	V/V	64	30565	451	4.05
ASA_WVS_1PNPDK20080104_095229_000019942064_00451_30565_7448.N1						IS2	V/V	64	30565	451	4.05
ASA_WVS_1PNPDK20080104_104352_000000742064_00452_30566_7550.N1						IS2	V/V	64	30566	452	4.05
ASA_WVS_1PNPDK20080104_104931_000000892064_00452_30566_7553.N1						IS2	V/V	64	30566	452	4.05
ASA_WVS_1PNPDK20080104_105655_000011692064_00452_30566_7560.N1						IS2	V/V	64	30566	452	4.05
ASA_WVS_1PNPDK20080104_113305_000001202064_00452_30566_7563.N1						IS2	V/V	64	30566	452	4.05
ASA_WVS_1PNPDK20080104_113858_000015742064_00452_30566_7572.N1						IS2	V/V	64	30566	452	4.05
ASA_WVS_1PNPDK20080104_122338_000010042064_00453_30567_7683.N1						IS2	V/V	64	30567	453	4.05
ASA_WVS_1PNPDK20080104_125042_000003752064_00453_30567_7693.N1						IS2	V/V	64	30567	453	4.05
ASA_WVS_1PNPDK20080104_131341_000003002064_00453_30567_7706.N1						IS2	V/V	64	30567	453	4.05
ASA_WVS_1PNPDK20080104_132720_000000742064_00453_30567_7701.N1						IS2	V/V	64	30567	453	4.05
ASA_WVS_1PNPDK20080104_132952_000005792064_00453_30567_7711.N1						IS2	V/V	64	30567	453	4.05
ASA_WVS_1PNPDK20080104_140749_000005842064_00454_30568_7826.N1						IS2	V/V	64	30568	454	4.05
ASA_WVS_1PNPDK20080104_142613_000006752064_00454_30568_7835.N1						IS2	V/V	64	30568	454	4.05
ASA_WVS_1PNPDK20080104_145417_000003752064_00454_30568_7845.N1						IS2	V/V	64	30568	454	4.05
ASA_WVS_1PNPDK20080104_150424_000005092064_00454_30568_7852.N1						IS2	V/V	64	30568	454	4.05
ASA_WVS_1PNPDK20080104_155340_000000742064_00455_30569_7966.N1						IS2	V/V	64	30569	455	4.05
ASA_WVS_1PNPDK20080104_155754_000012142064_00455_30569_7975.N1						IS2	V/V	64	30569	455	4.05
ASA_WVS_1PNPDK20080104_163453_000011092064_00455_30569_7989.N1						IS2	V/V	64	30569	455	4.05
ASA_WVS_1PNPDK20080104_173429_000014542064_00456_30570_8105.N1						IS2	V/V	64	30570	456	4.05
ASA_WVS_1PNPDK20080104_181932_000009742064_00456_30570_8117.N1						IS2	V/V	64	30570	456	4.05
ASA_WVS_1PNPDK20080104_190757_000018742064_00457_30571_8236.N1						IS2	V/V	64	30571	457	4.05
ASA_WVS_1PNPDK20080104_195605_000005402064_00457_30571_8243.N1						IS2	V/V	64	30571	457	4.05
ASA_WVS_1PNPDE20080104_204719_000019492064_00458_30572_4135.N1						IS2	V/V	64	30572	458	4.05
ASA_WVS_1PNPDE20080104_213641_000002702064_00458_30572_4145.N1						IS2	V/V	64	30572	458	4.05
ASA_WVS_1PNPDE20080104_214026_000000452064_00458_30572_4274.N1						IS2	V/V	64	30572	458	4.05
ASA_WVS_1PNPDE20080104_214522_000005092064_00458_30572_4277.N1						IS2	V/V	64	30572	458	4.05
ASA_WVS_1PNPDE20080104_220953_000000752064_00459_30573_4280.N1						IS2	V/V	64	30573	459	4.05
ASA_WVS_1PNPDE20080104_222825_000019192064_00459_30573_4287.N1						IS2	V/V	64	30573	459	4.05
ASA_WVS_1PNPDE20080104_231717_000003452064_00459_30573_4290.N1						IS2	V/V	64	30573	459	4.05
ASA_WVS_1PNPDE20080104_232217_000008992064_00459_30573_4422.N1						IS2	V/V	64	30573	459	4.05
ASA_WVS_1PNPDE20080104_233925_000007042064_00460_30574_4427.N1						IS2	V/V	64	30574	460	4.05



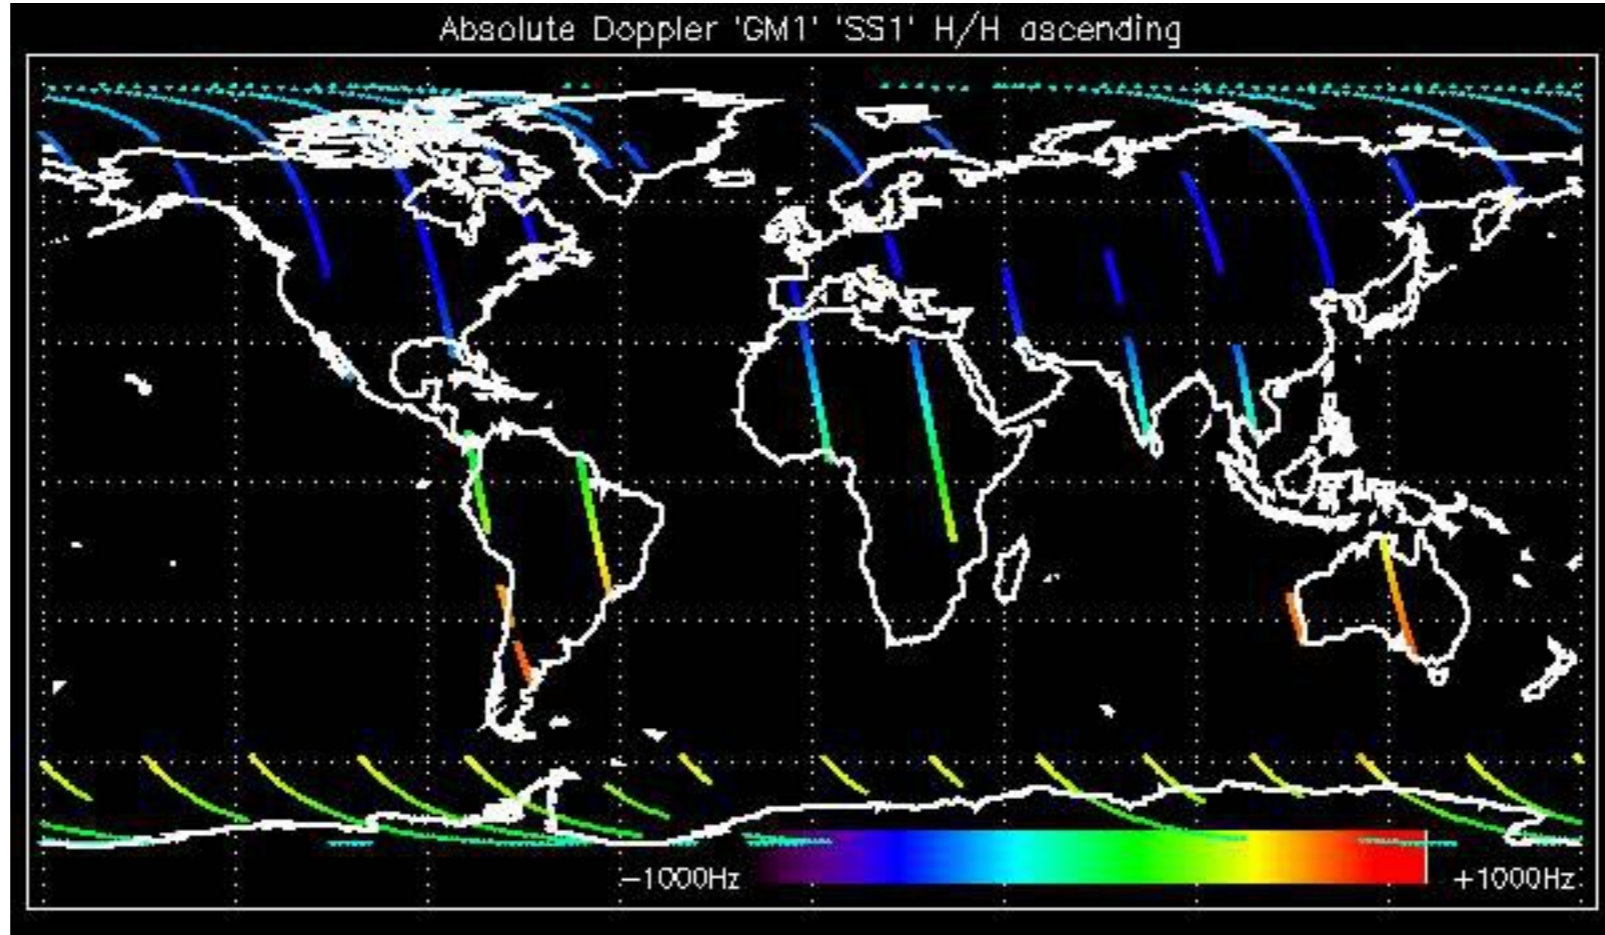


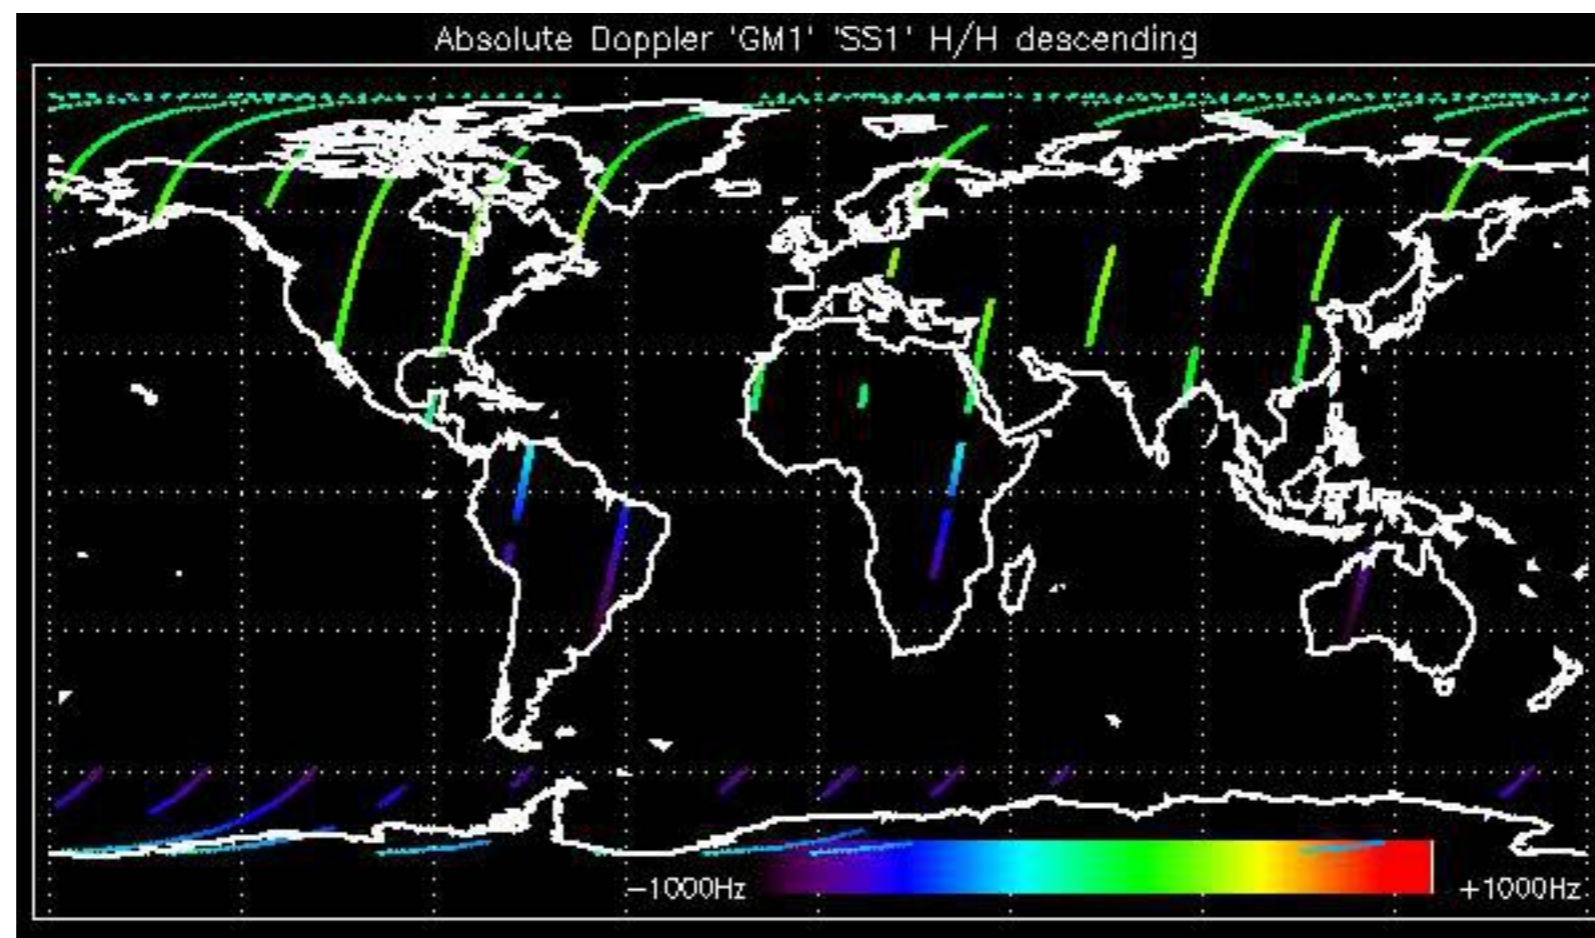


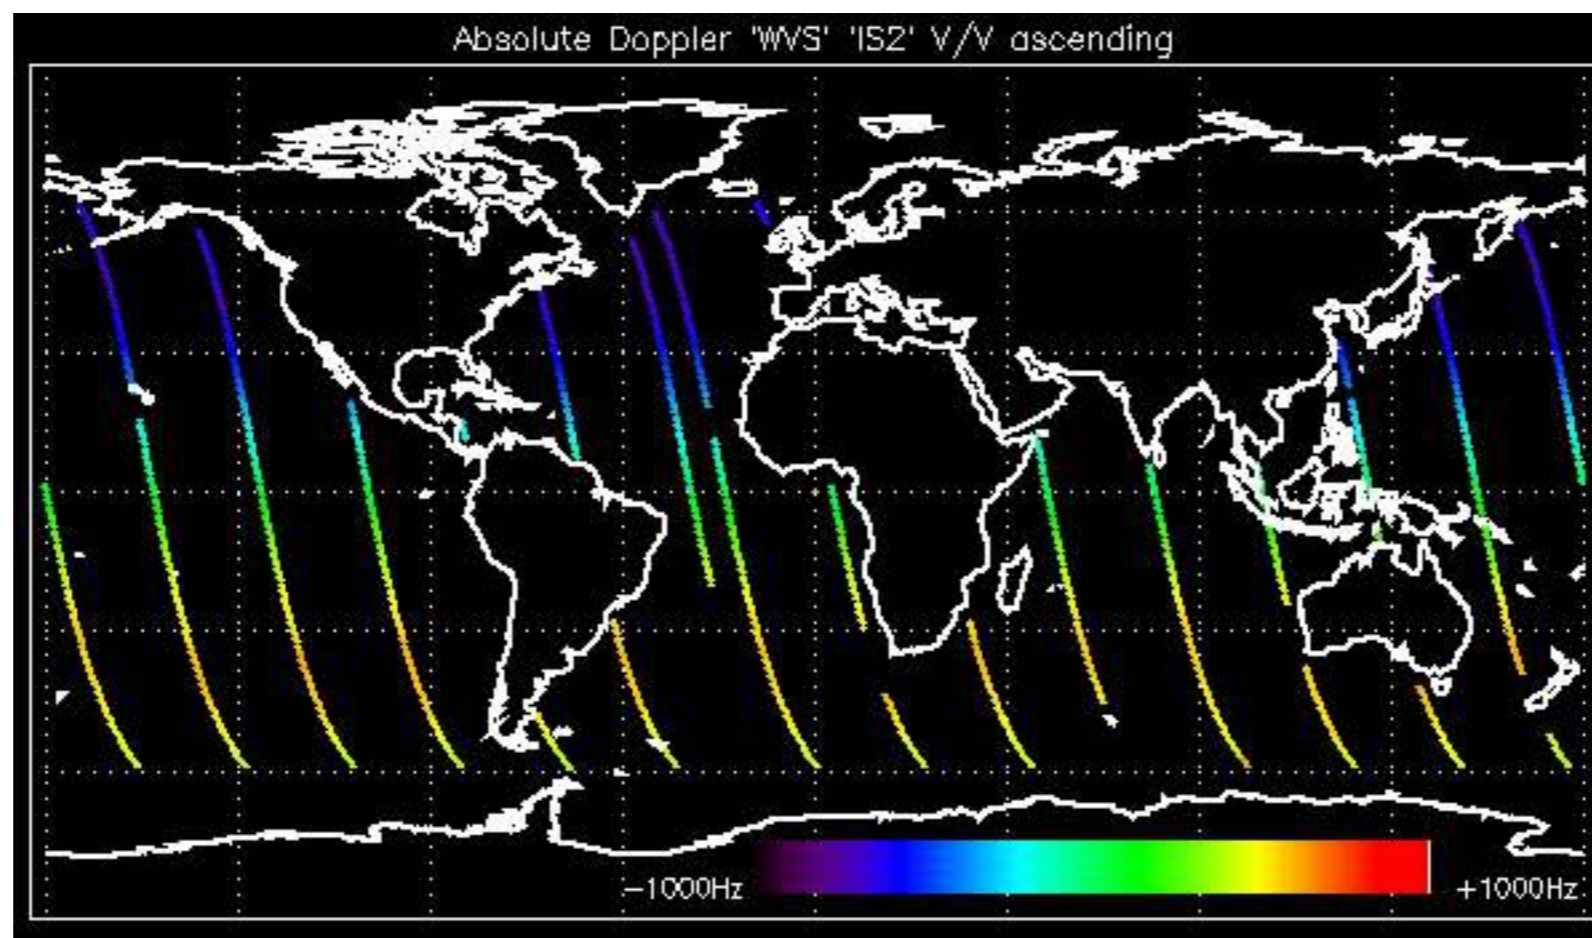


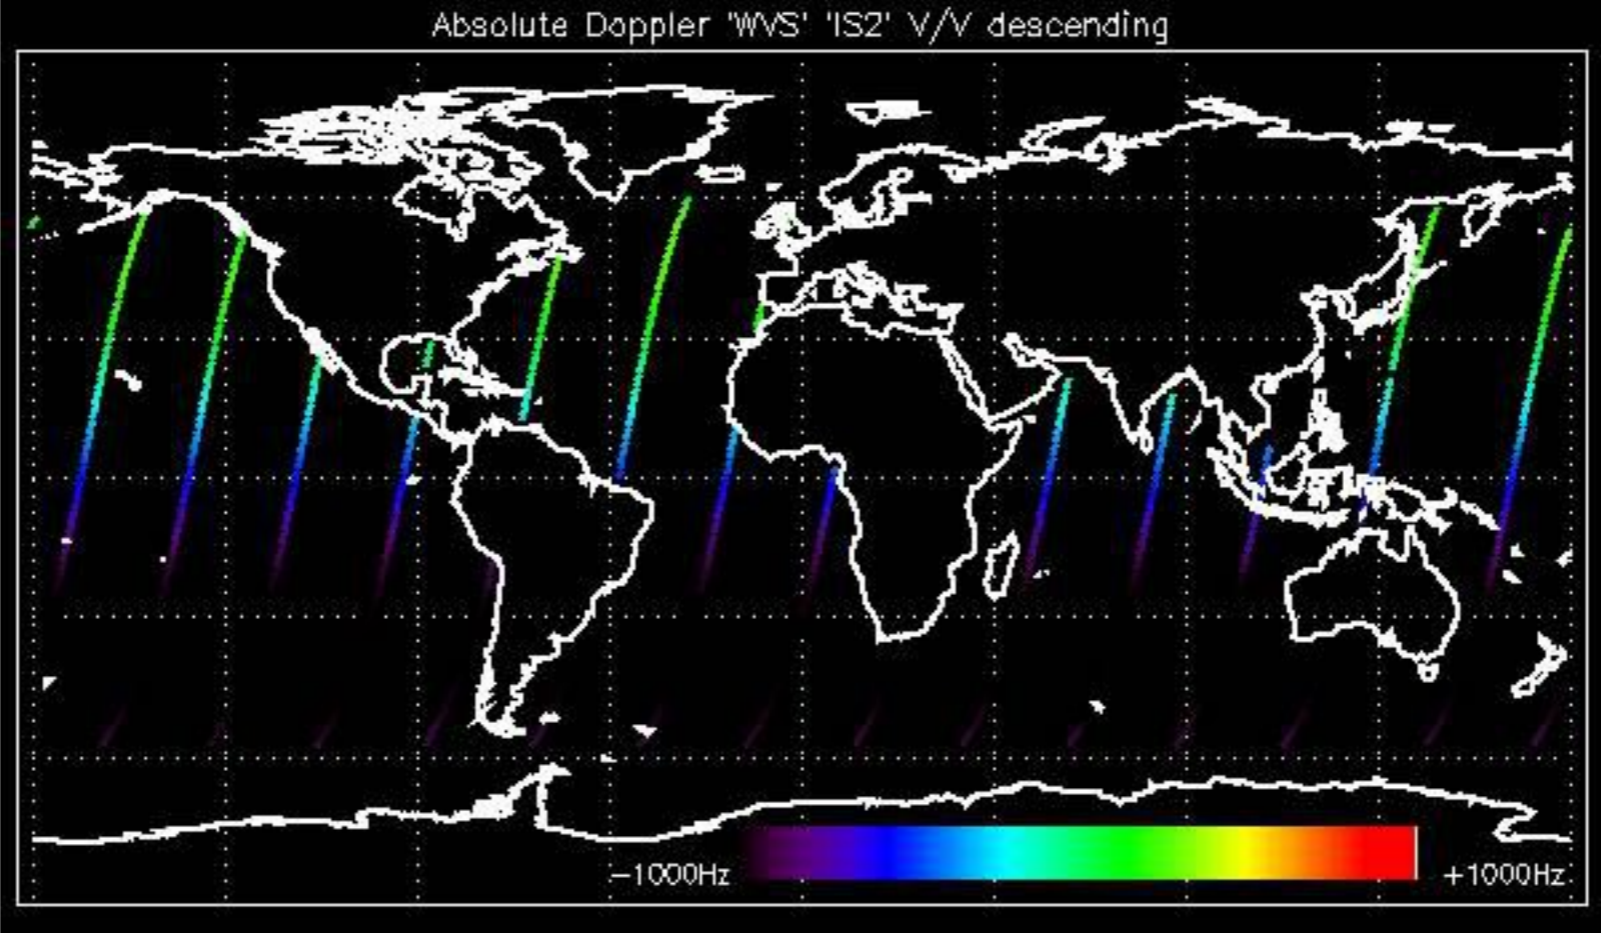


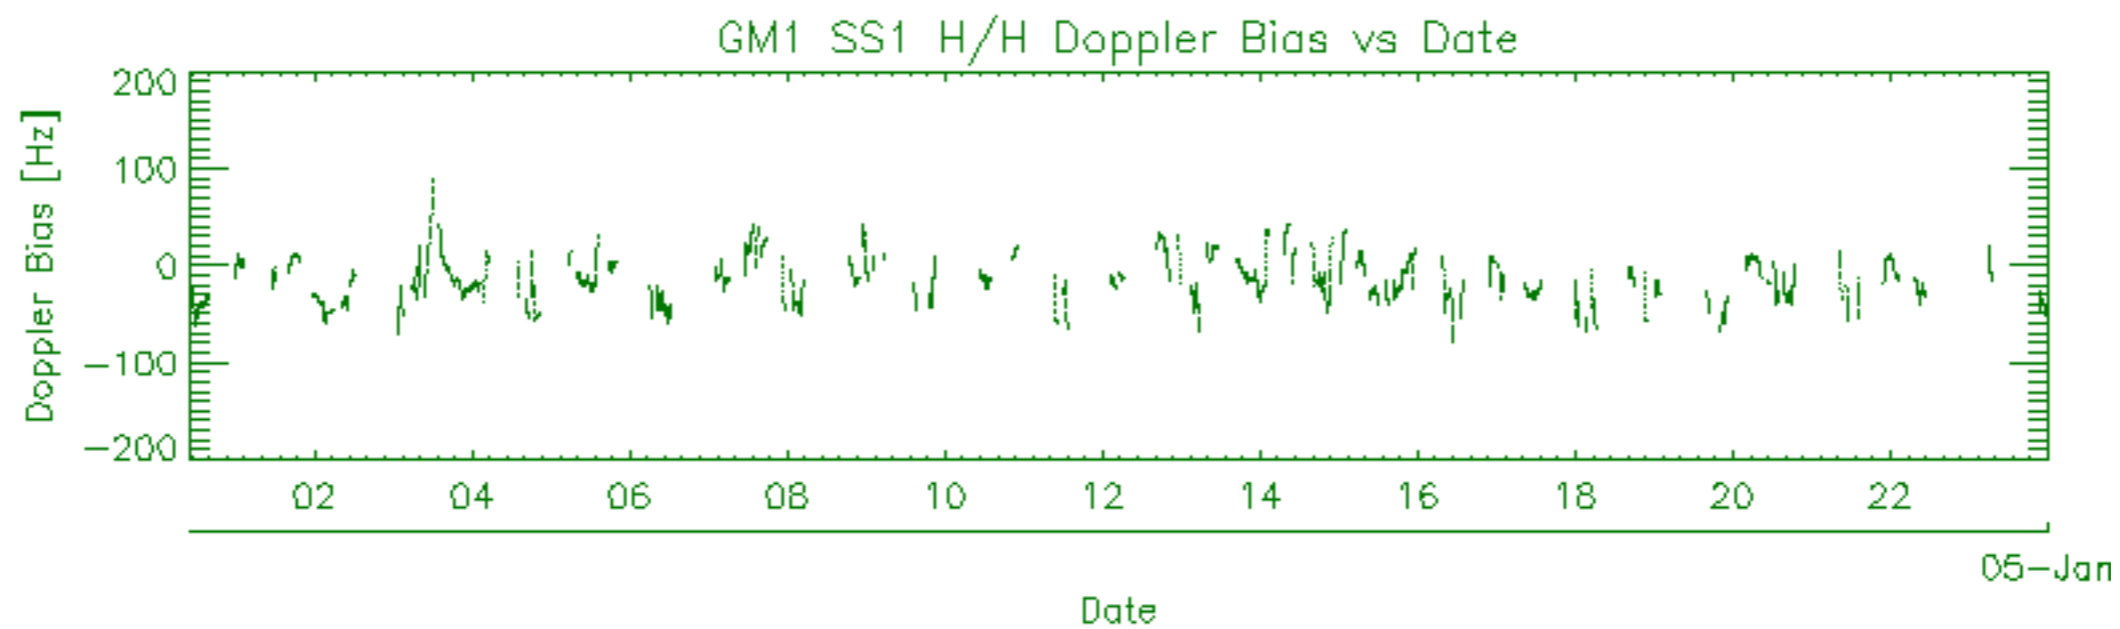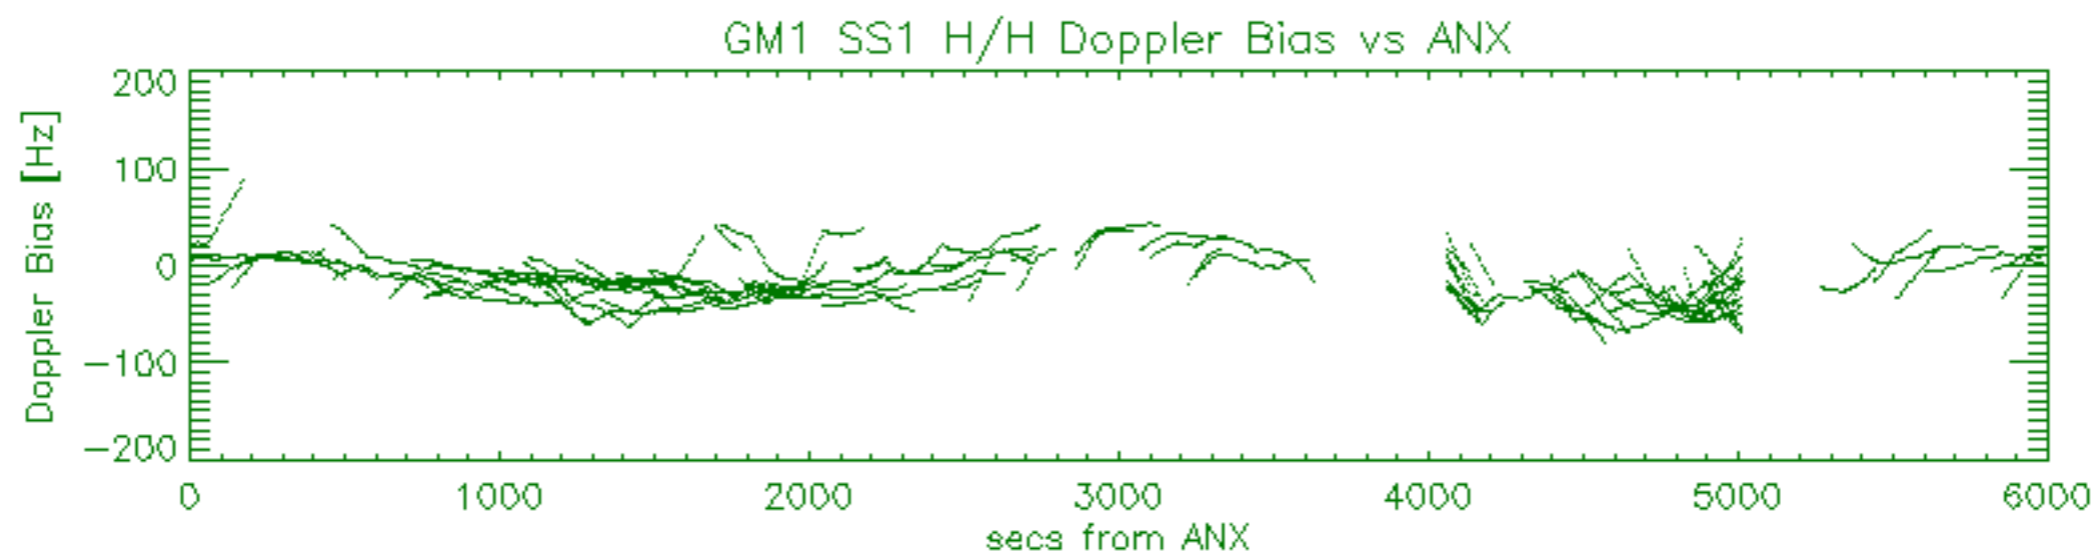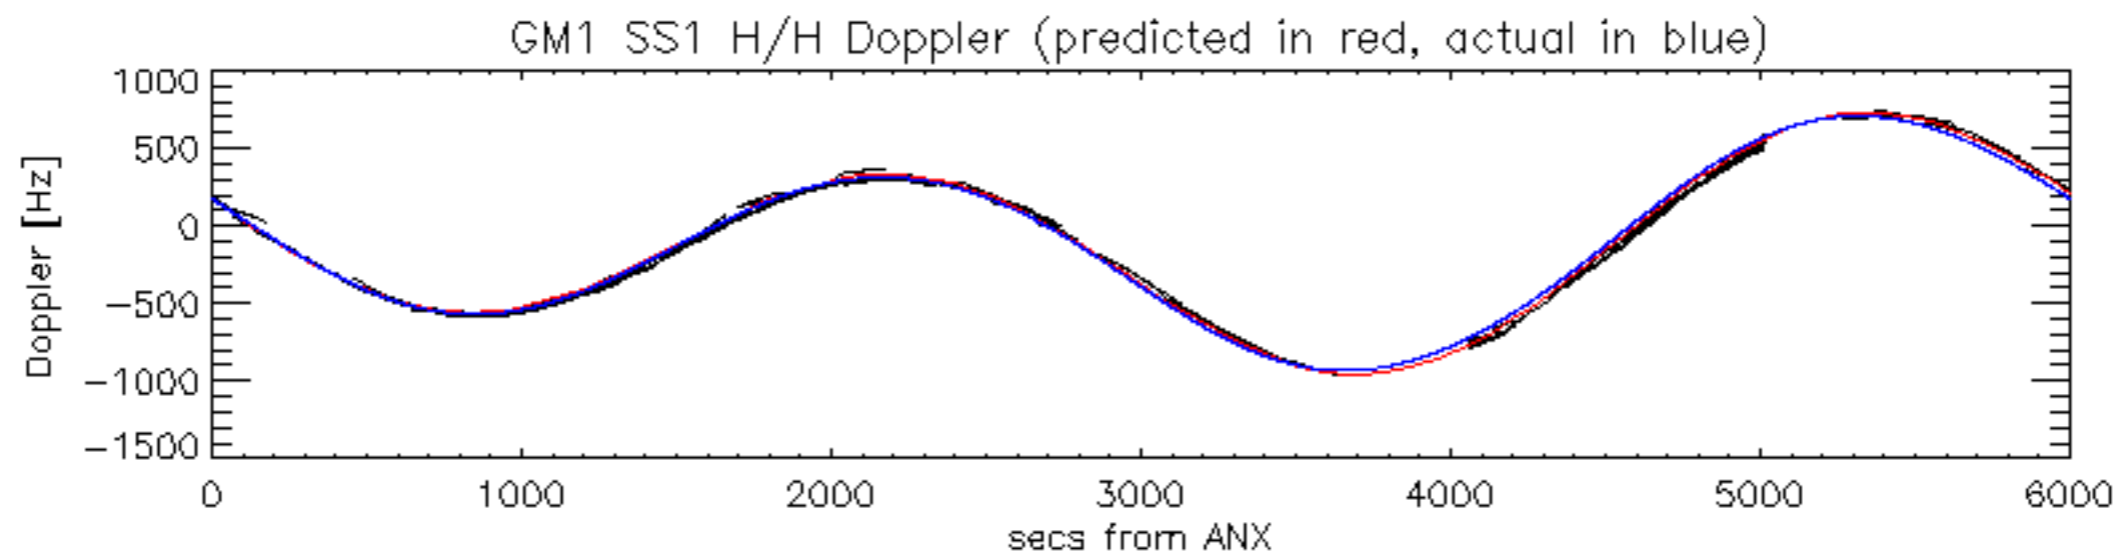



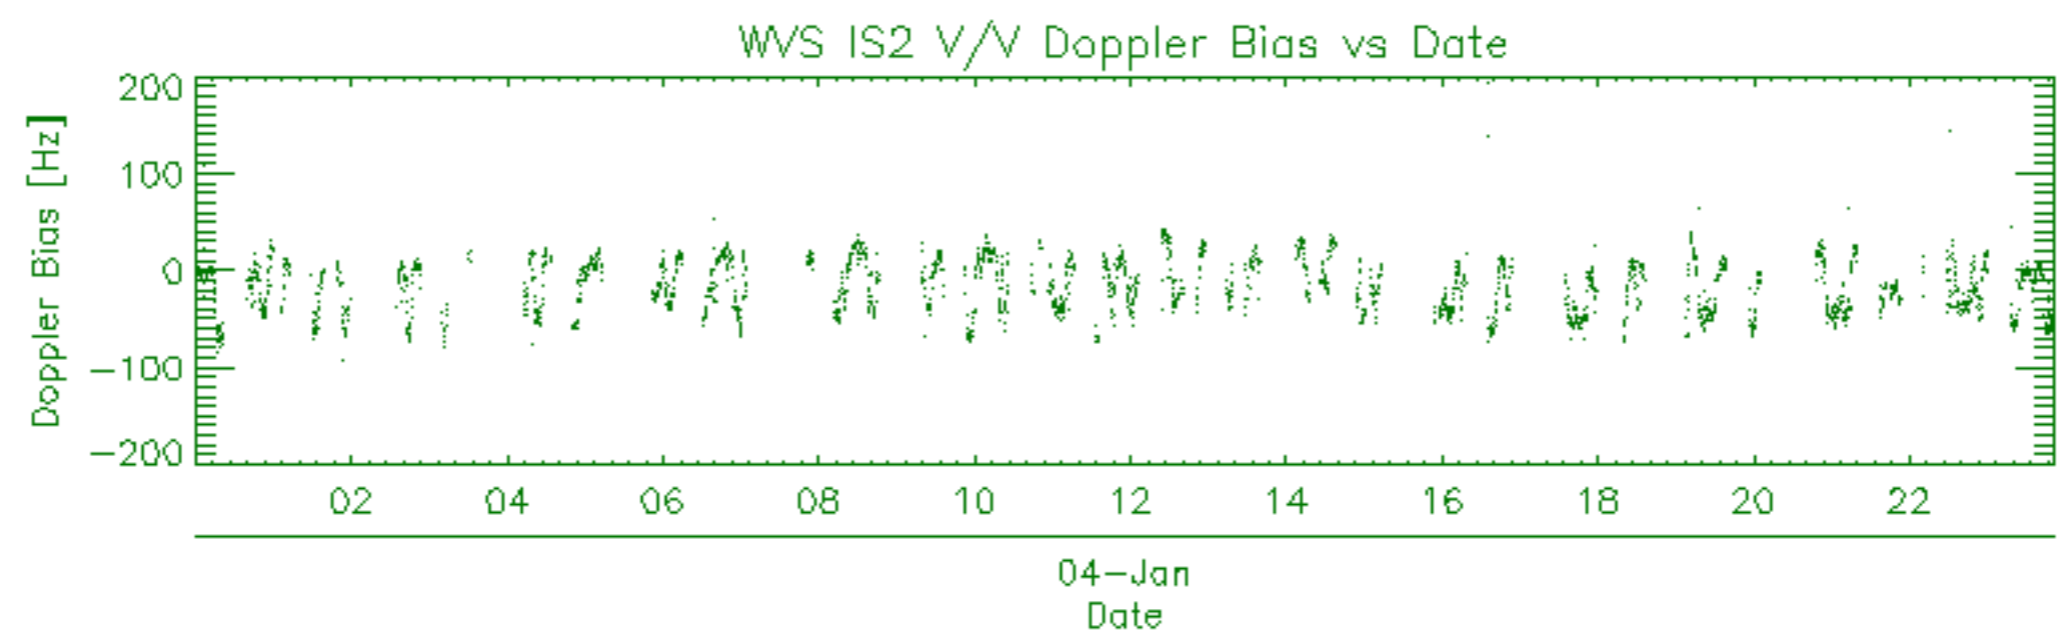
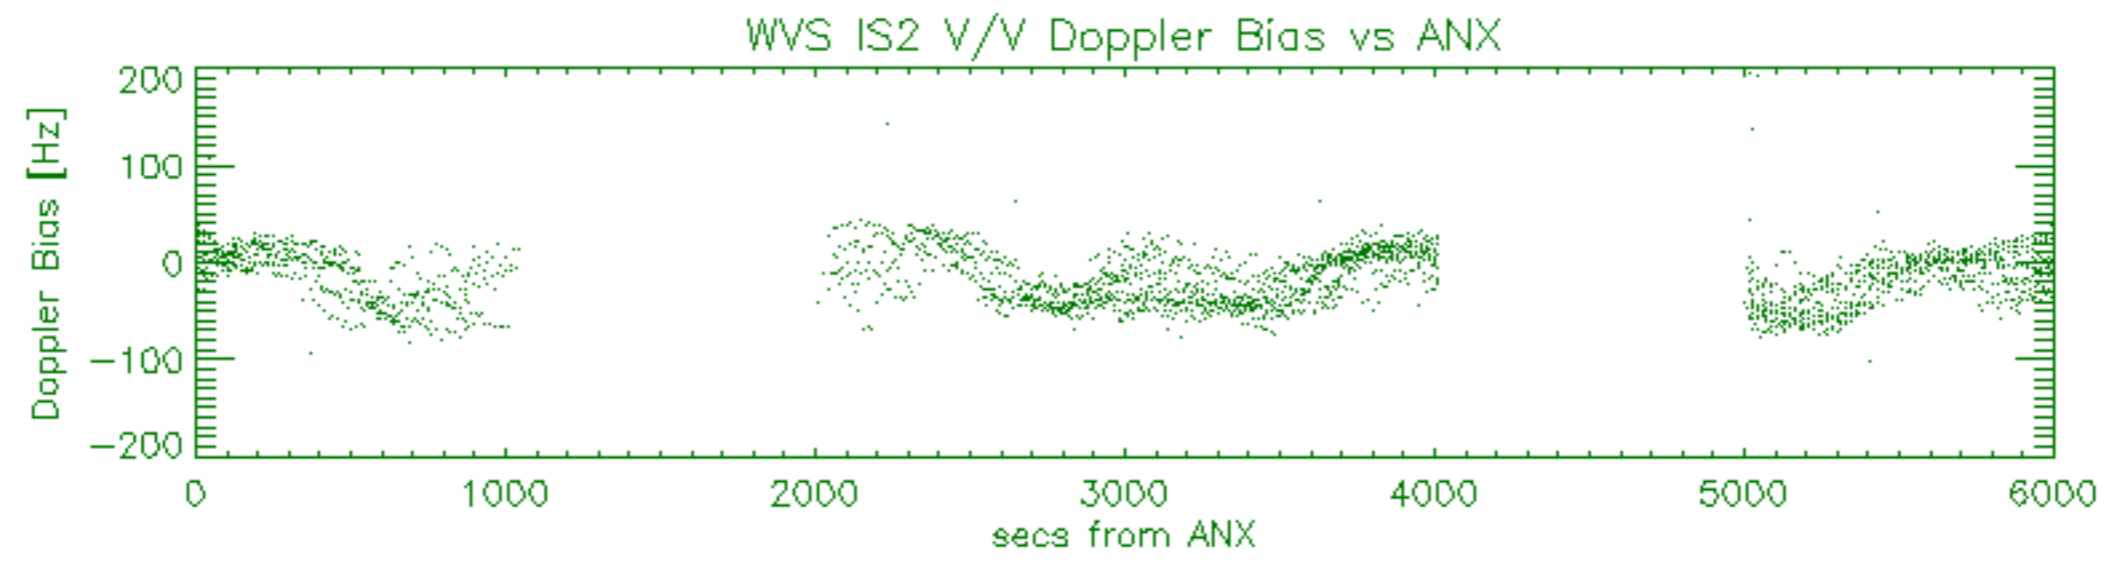
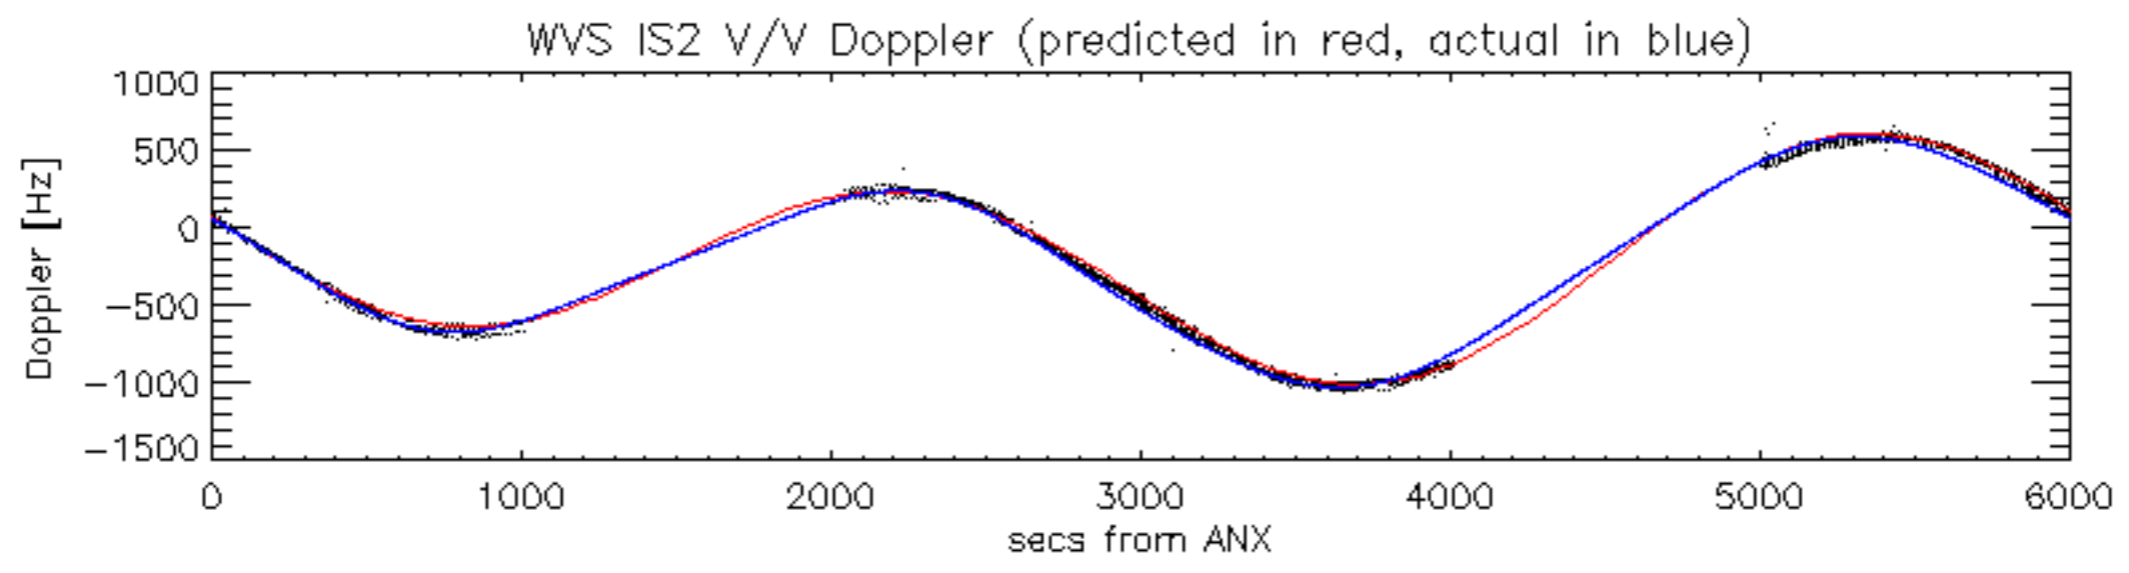


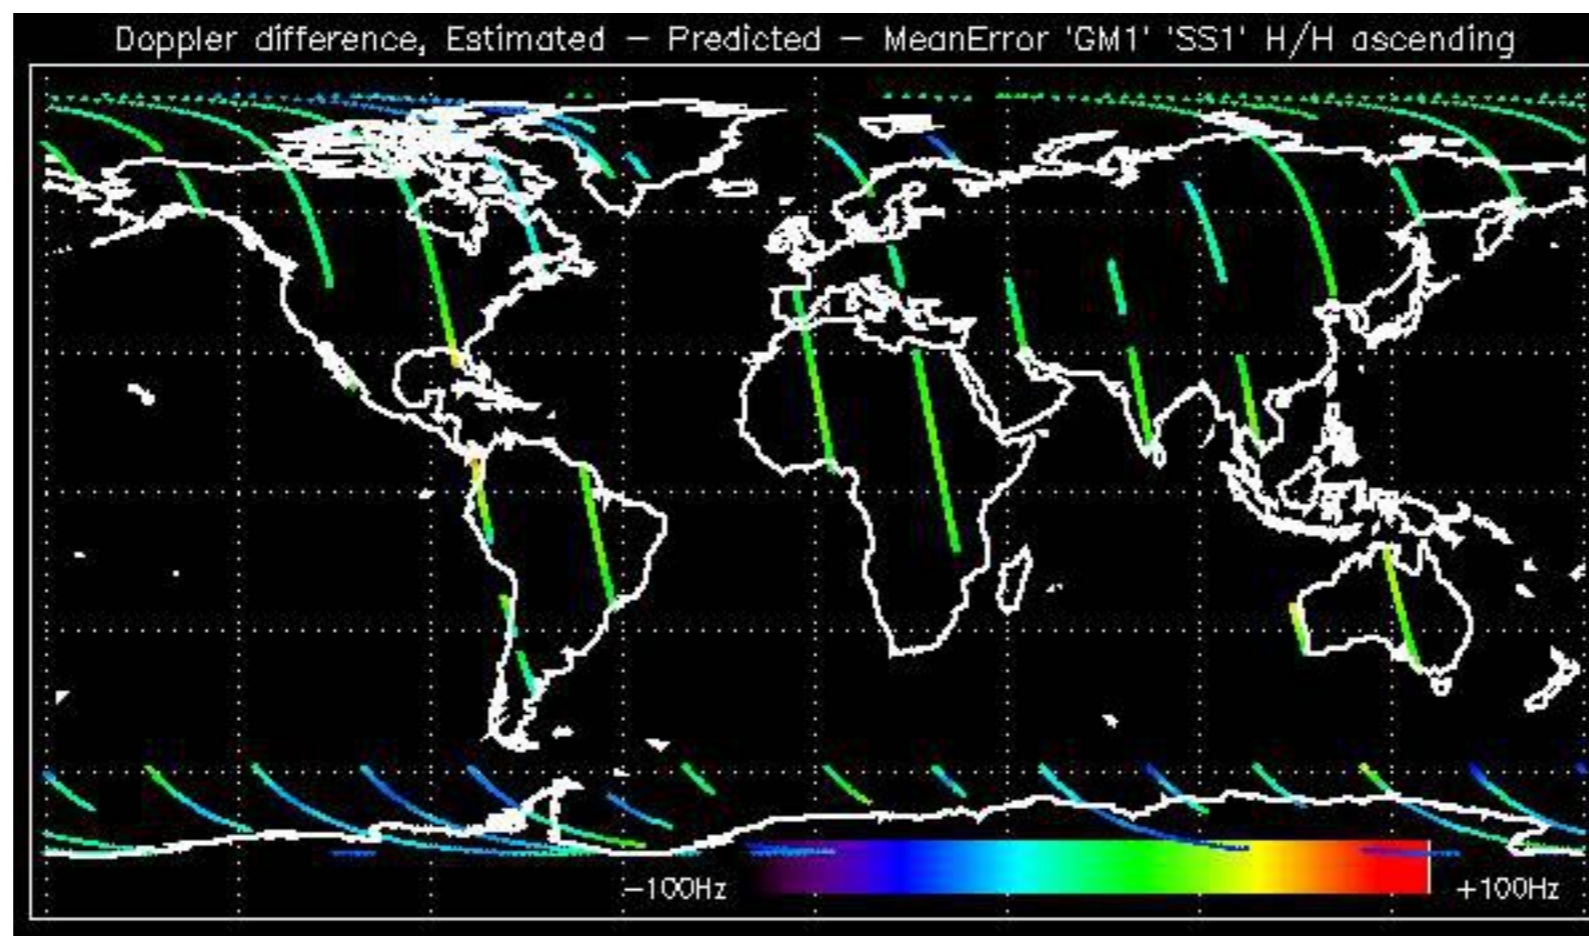


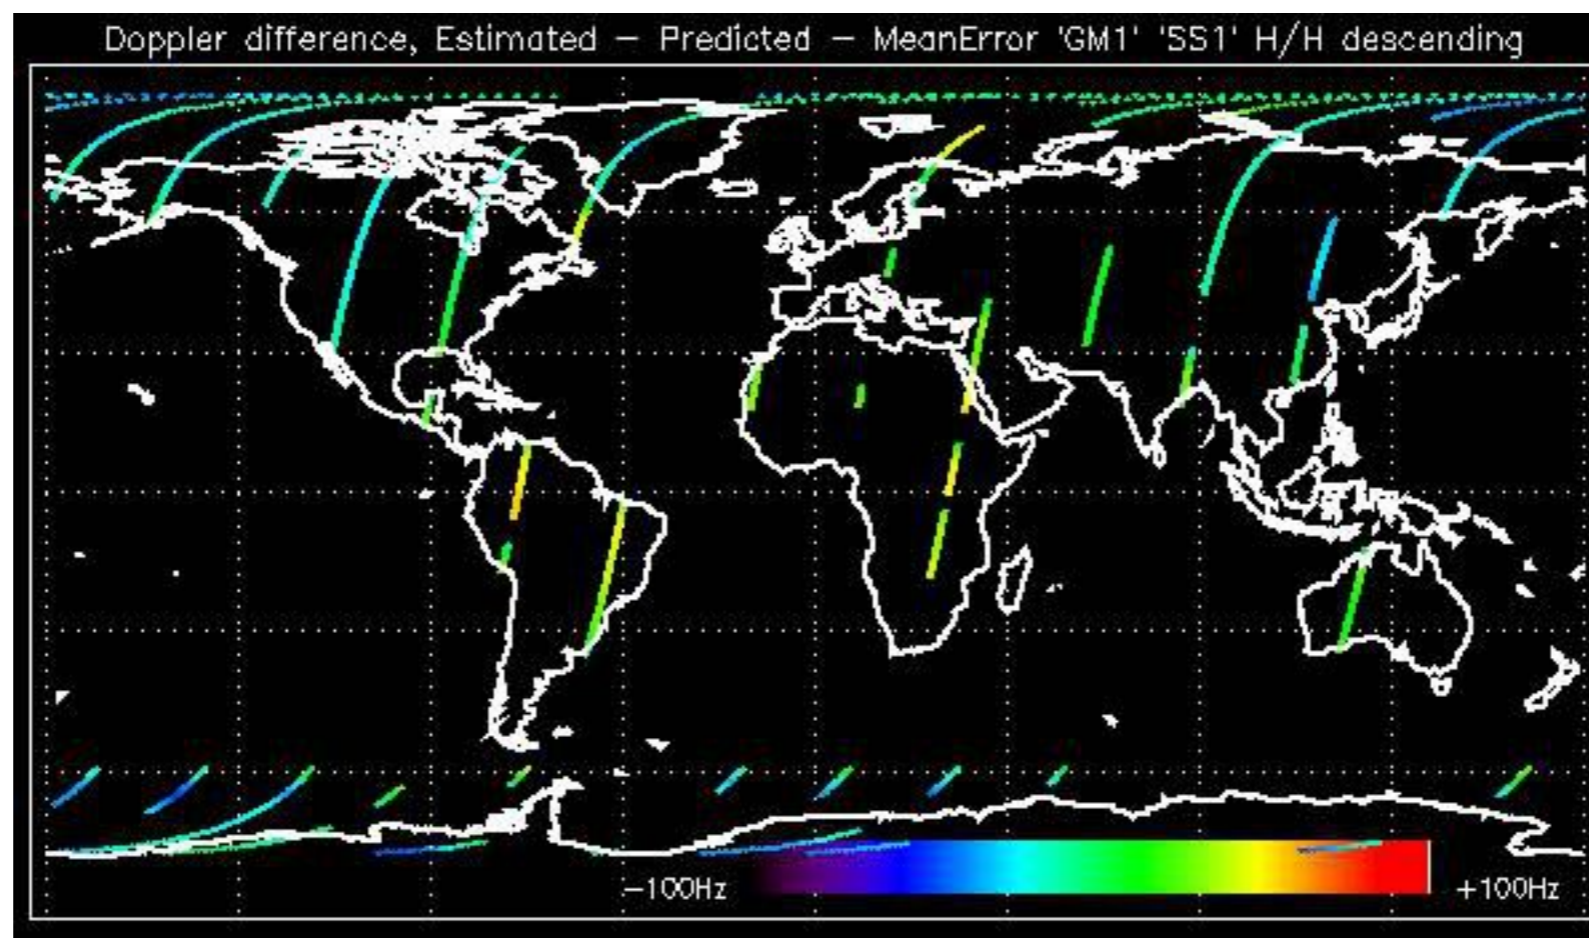


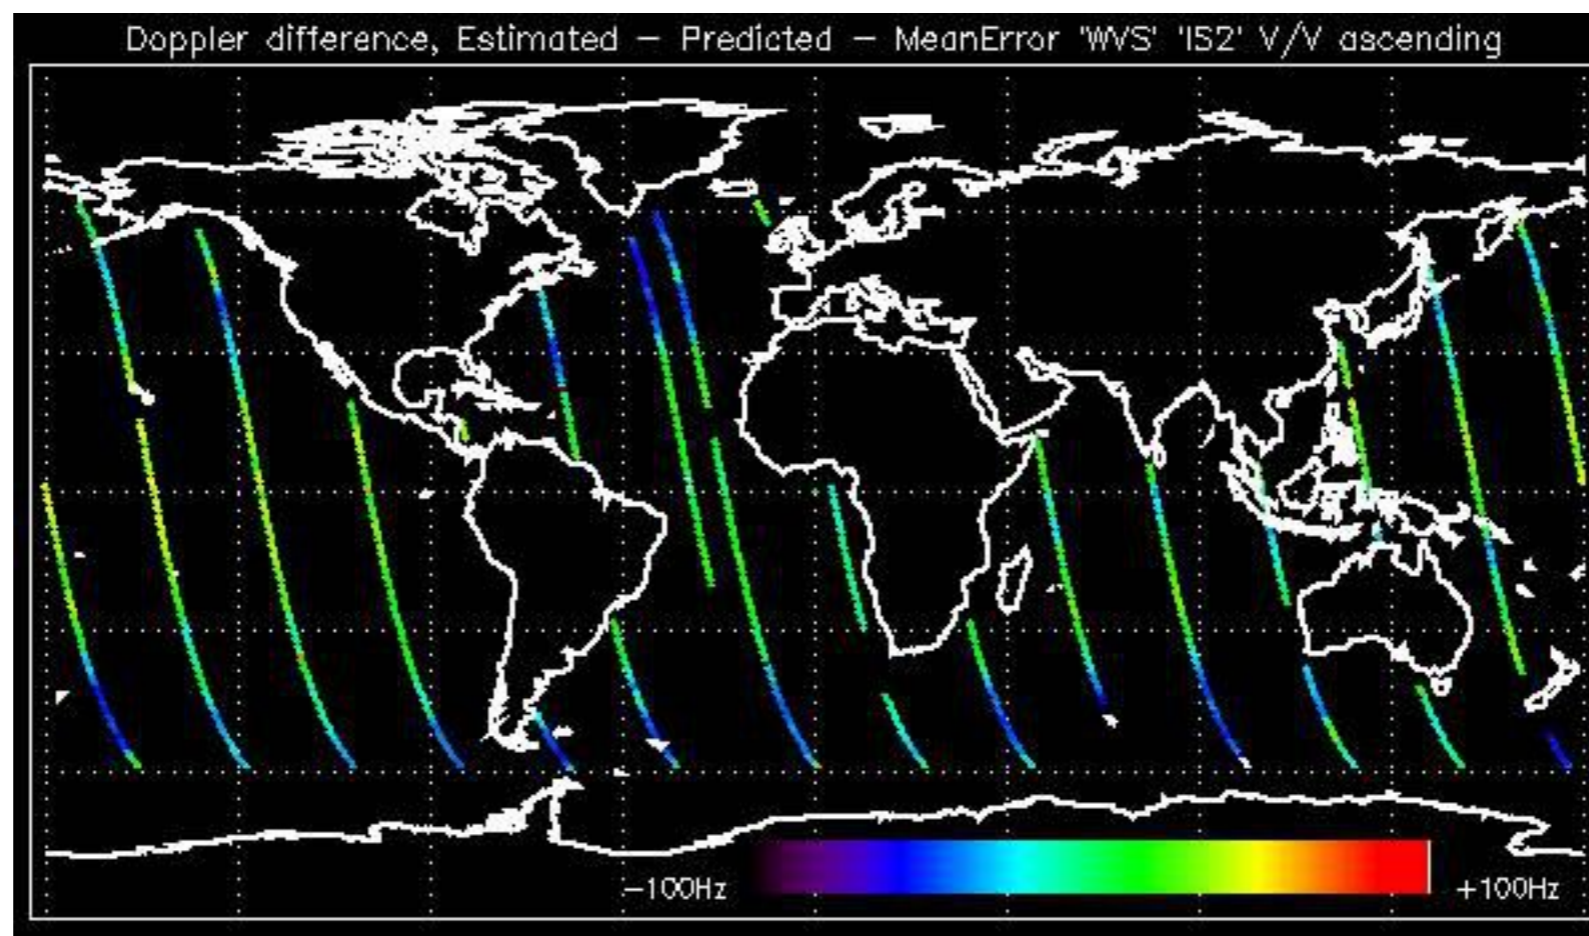


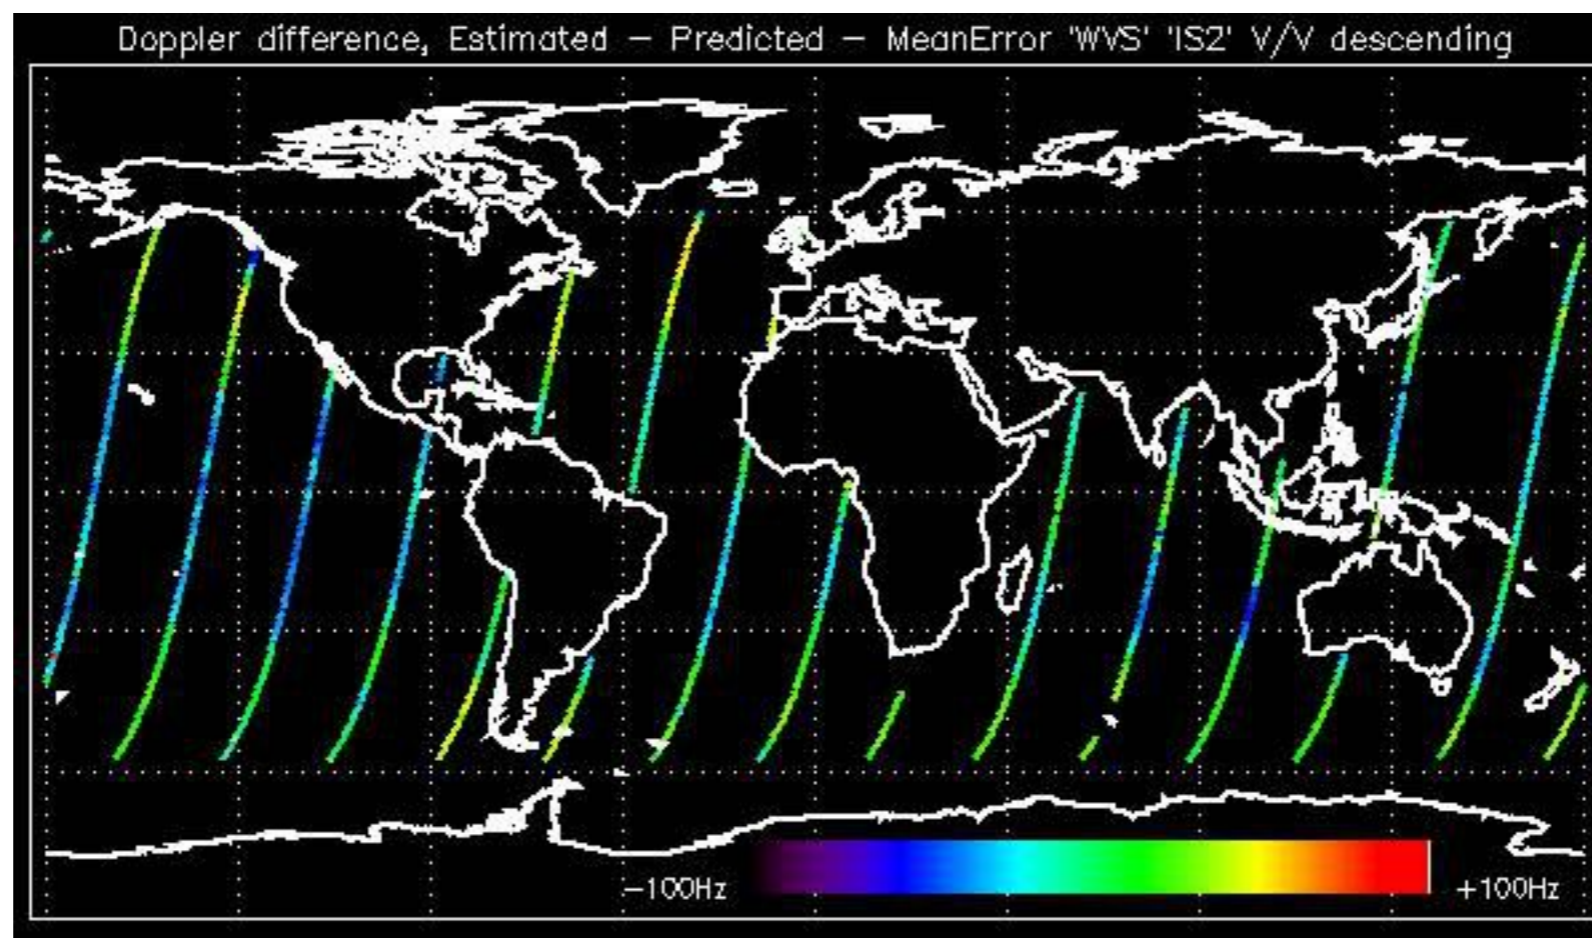

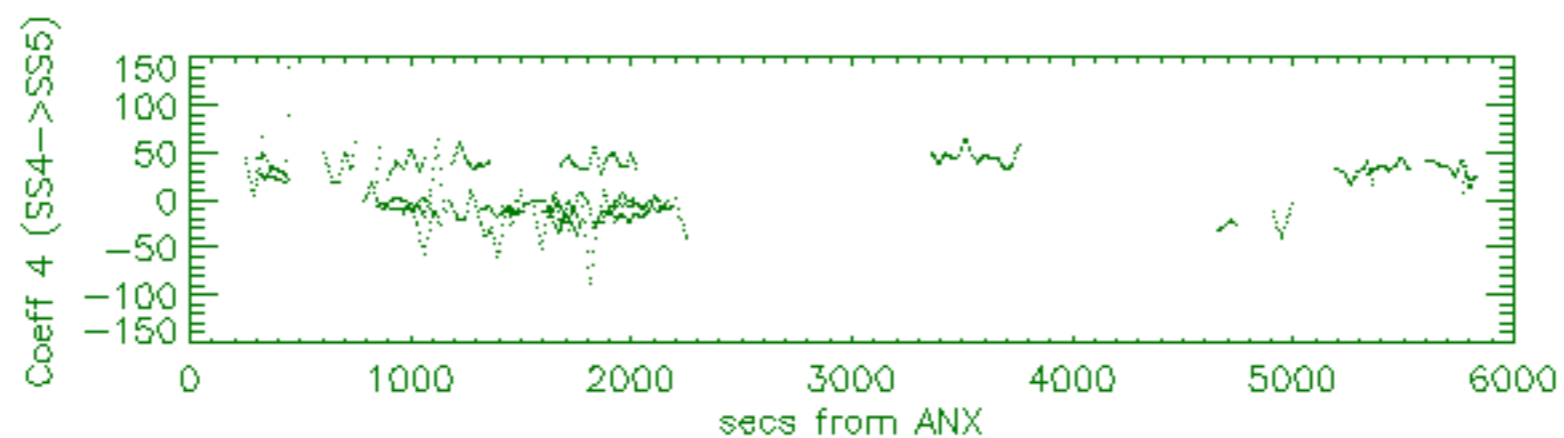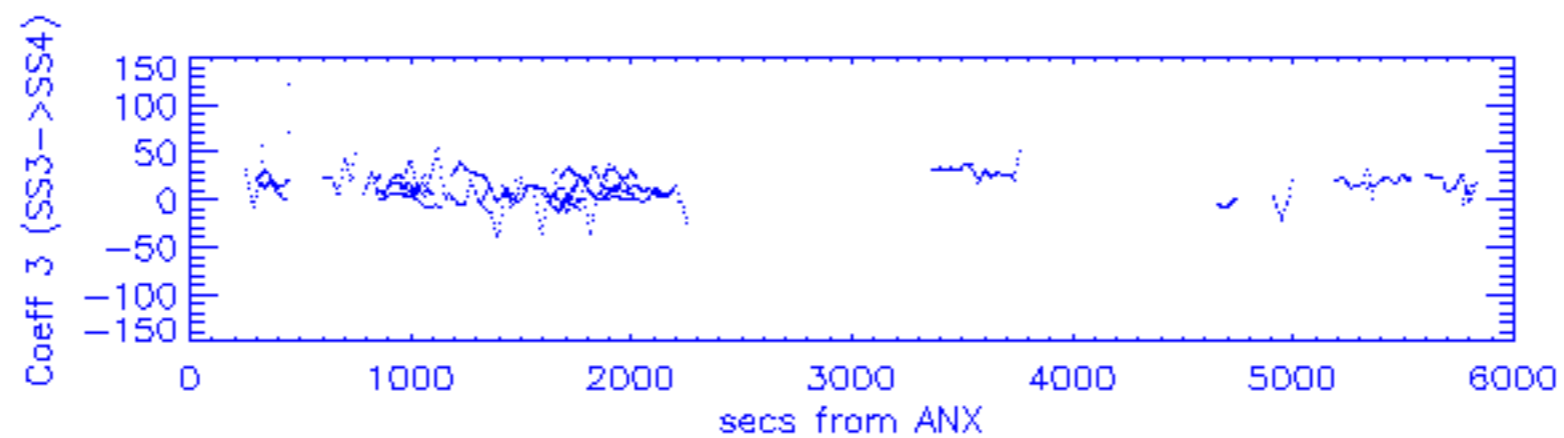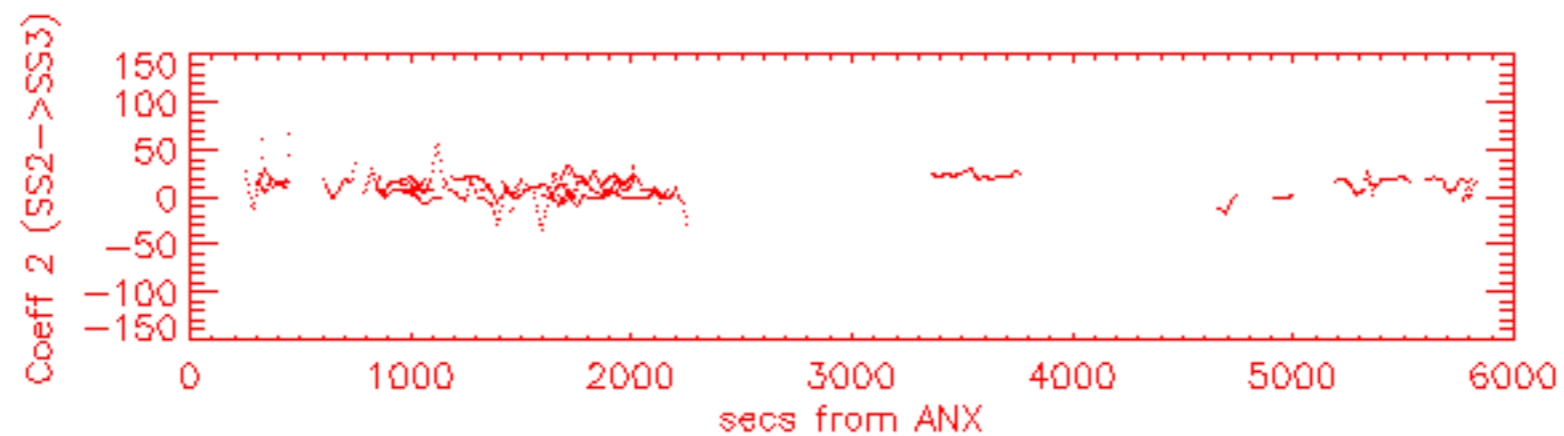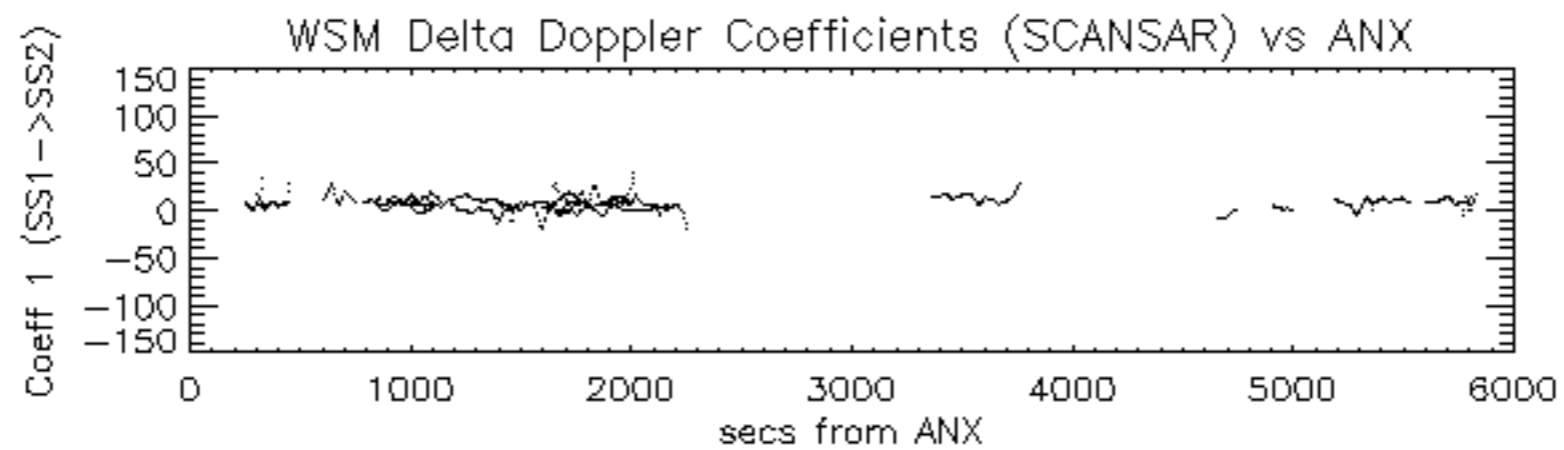


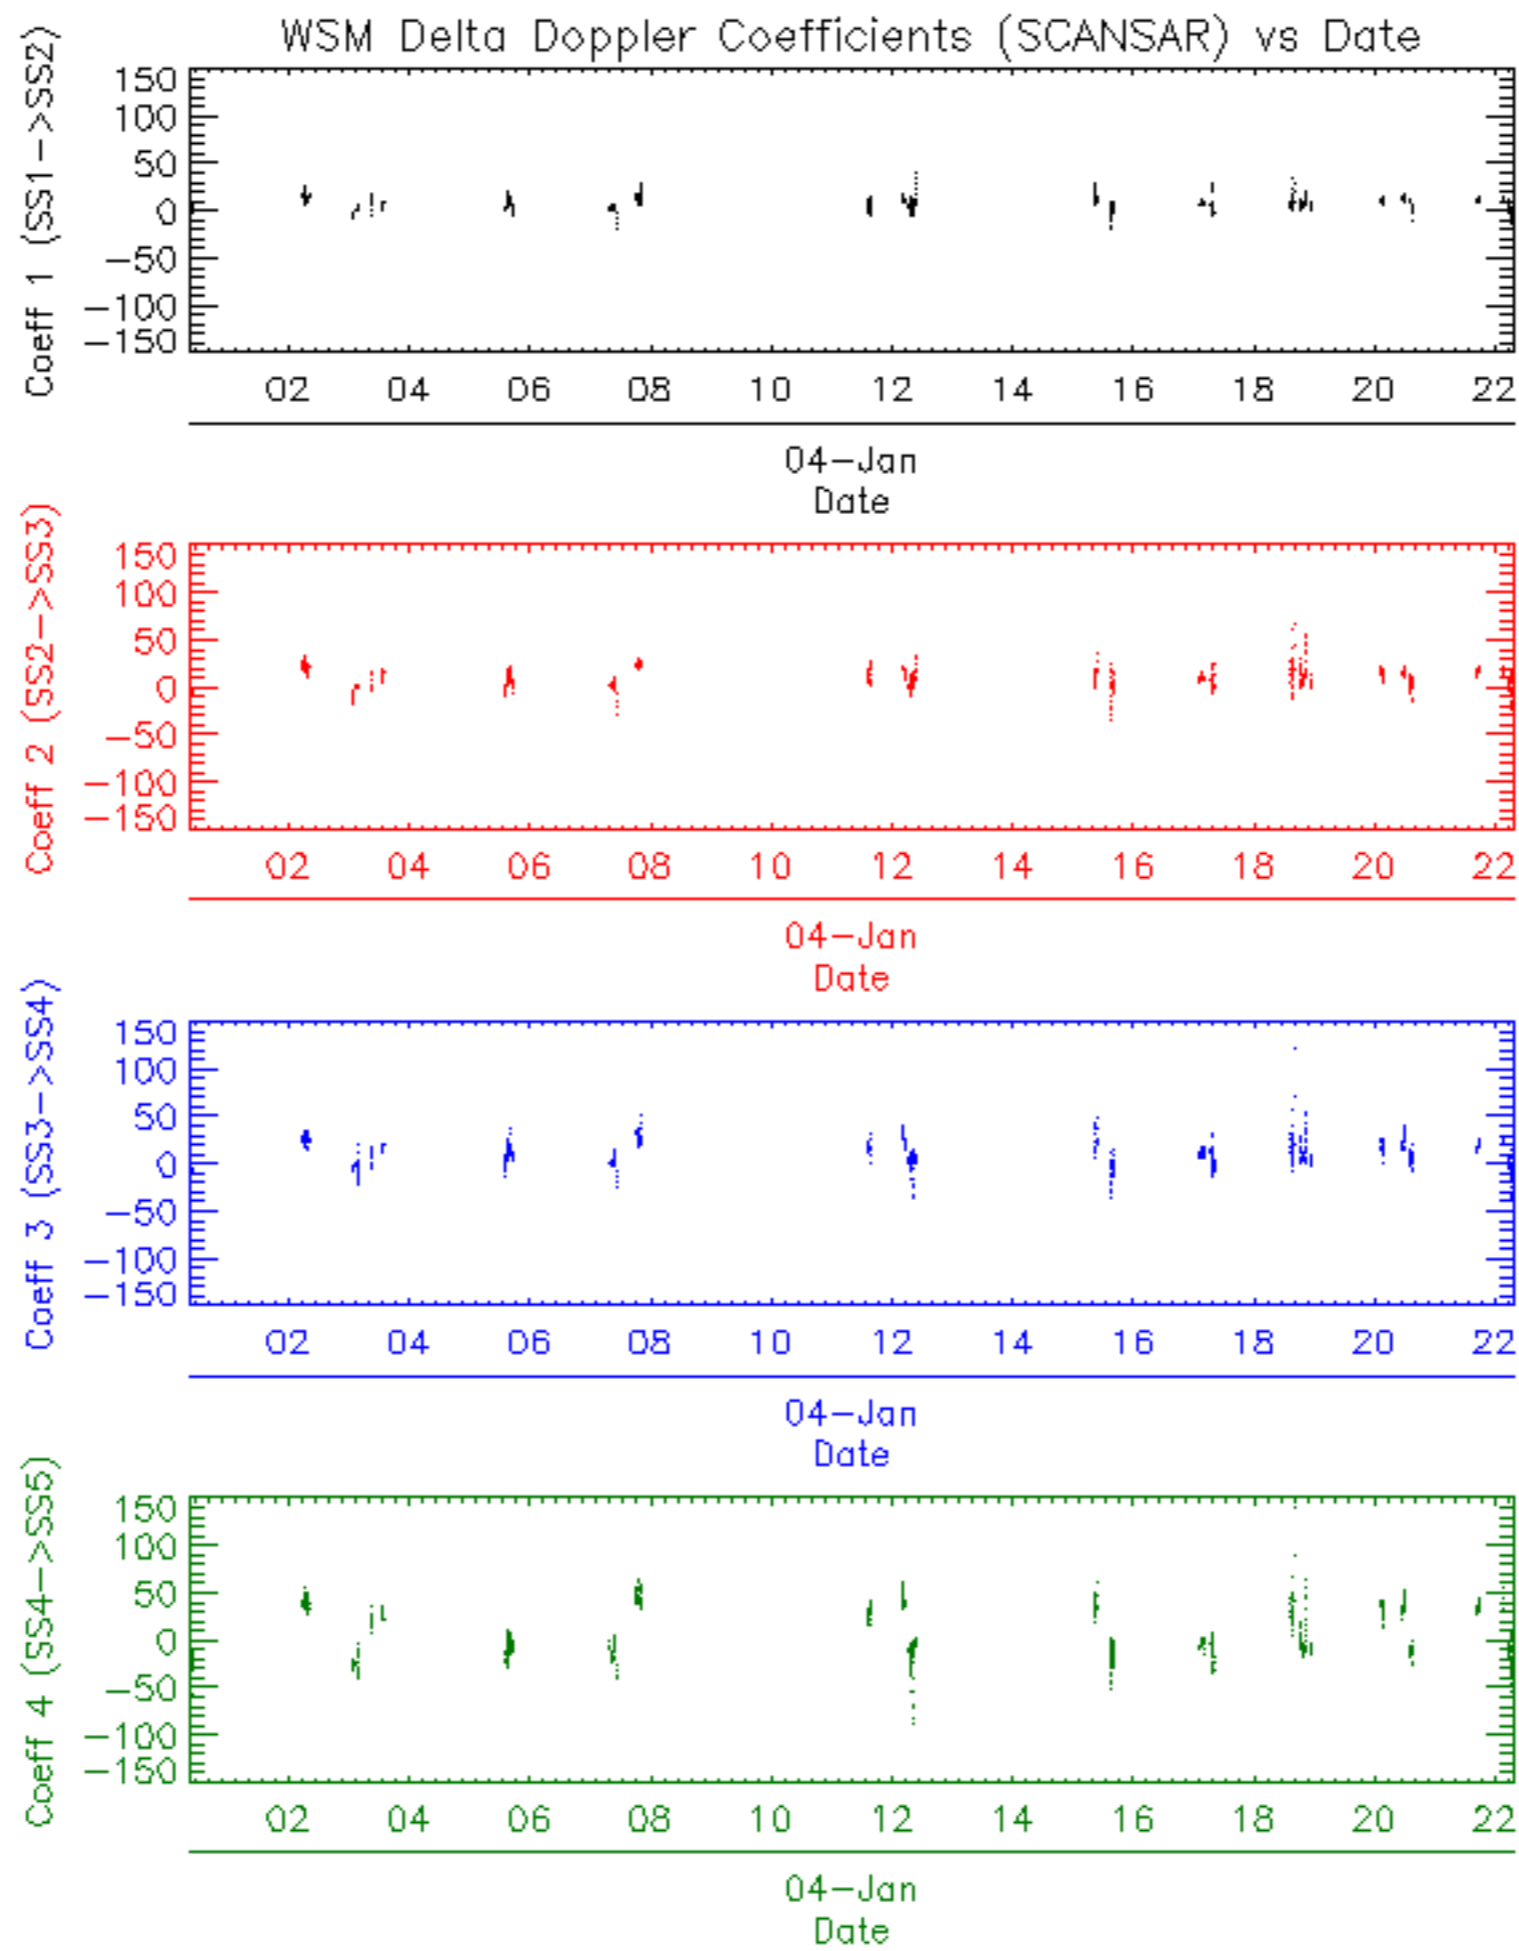

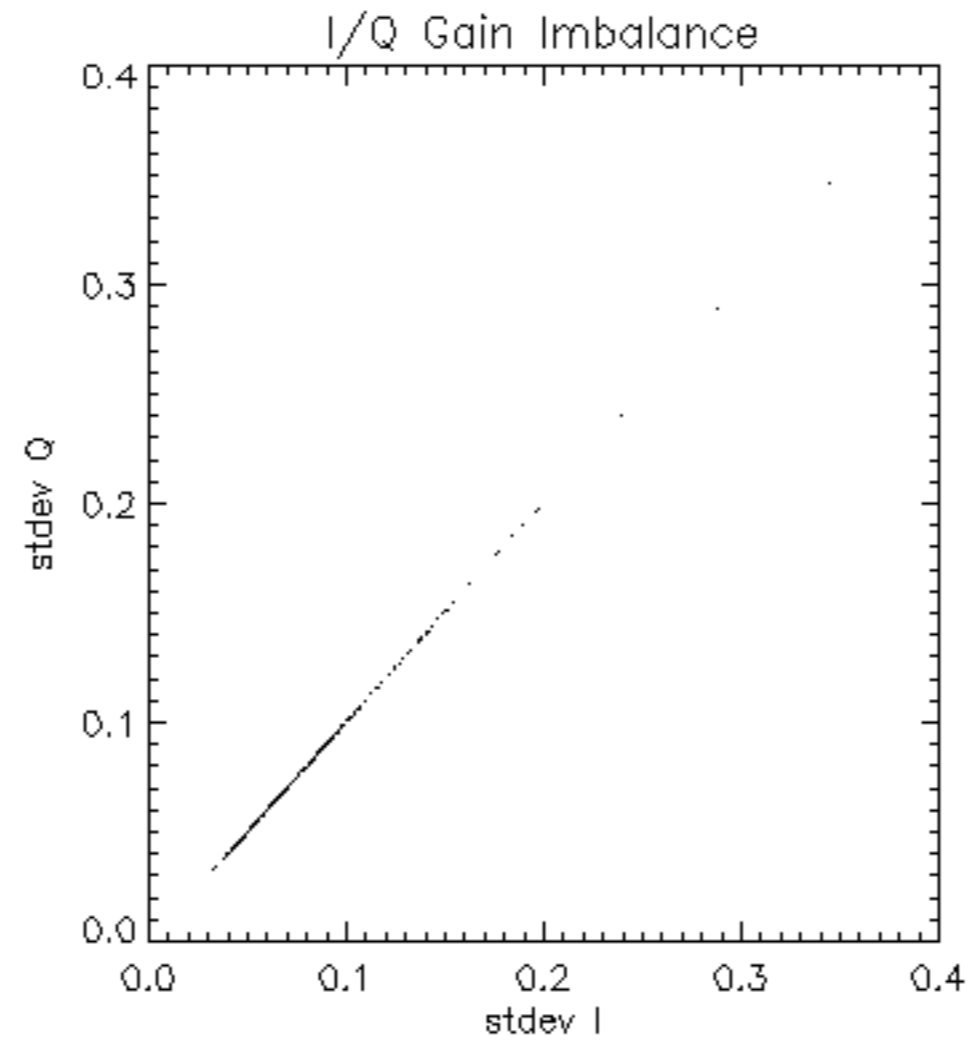


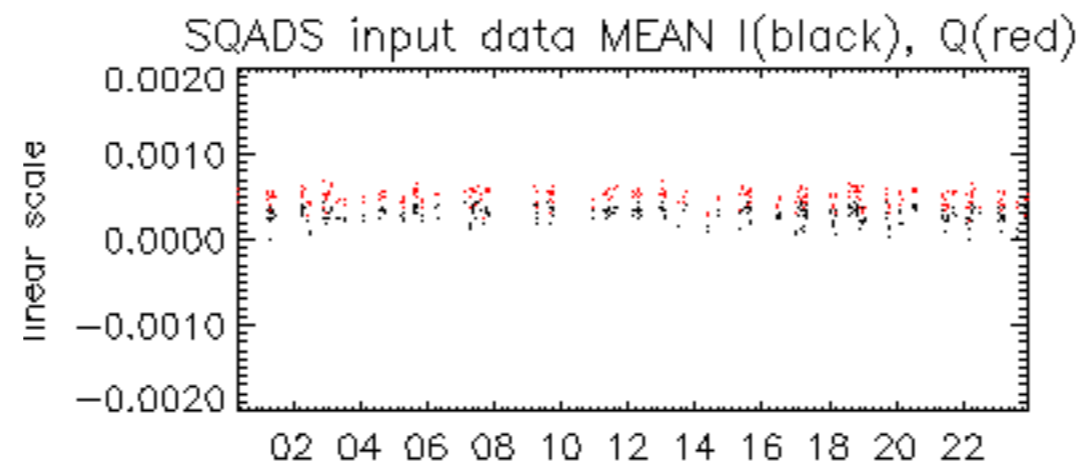


04-Jan

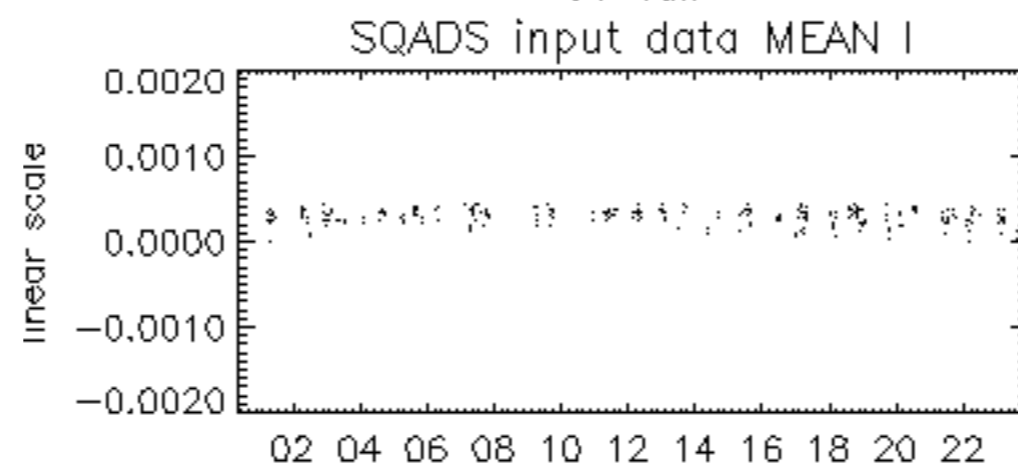


04-Jan

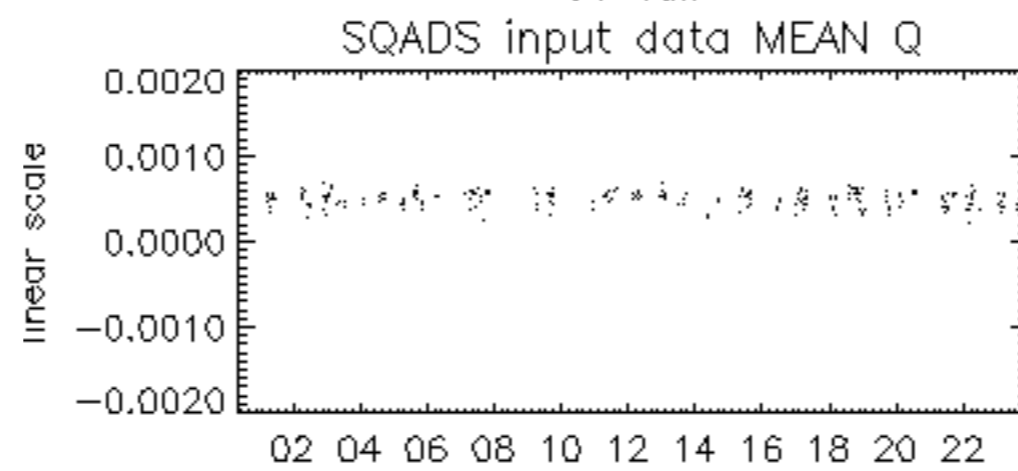


04-Jan

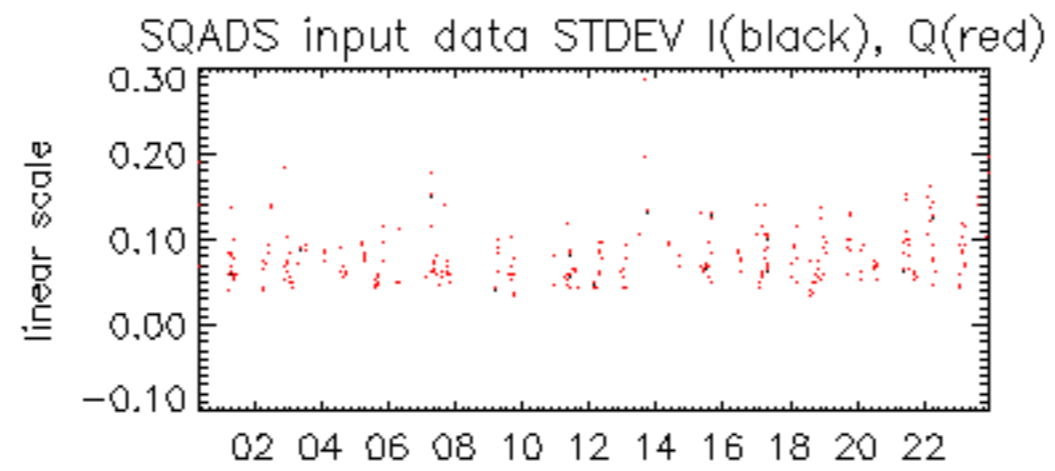


04-Jan

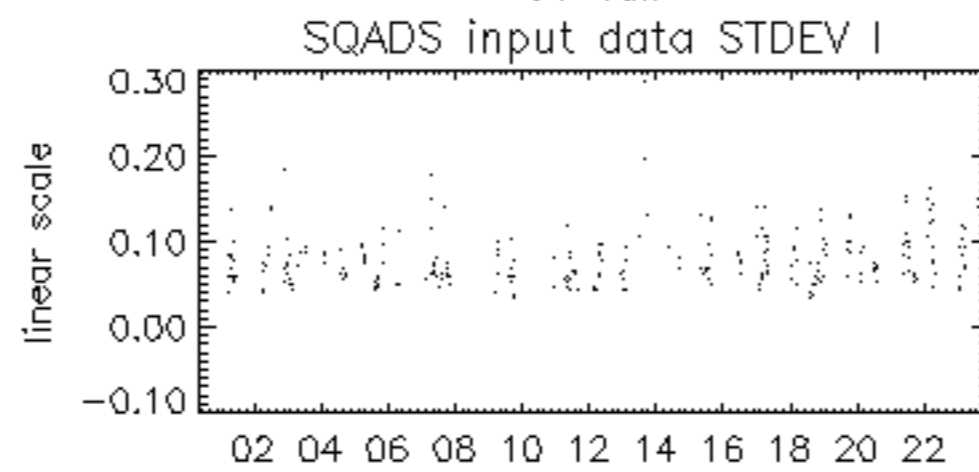


04-Jan

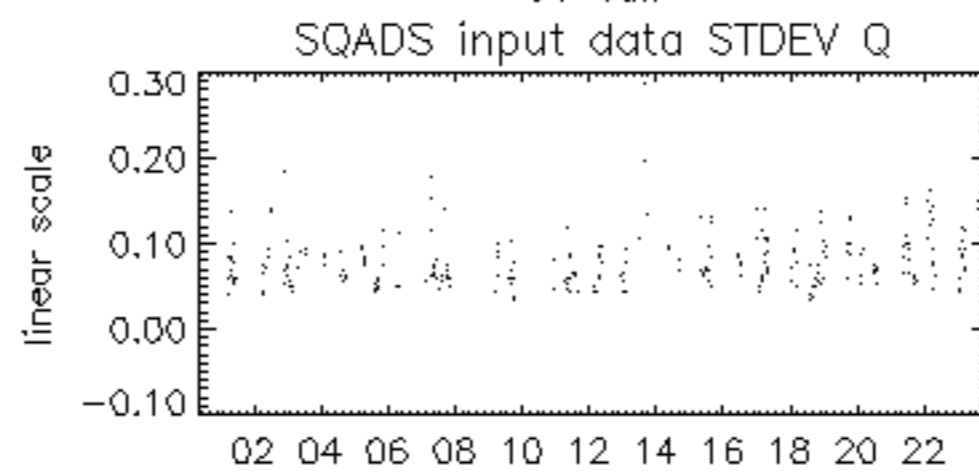


04-Jan

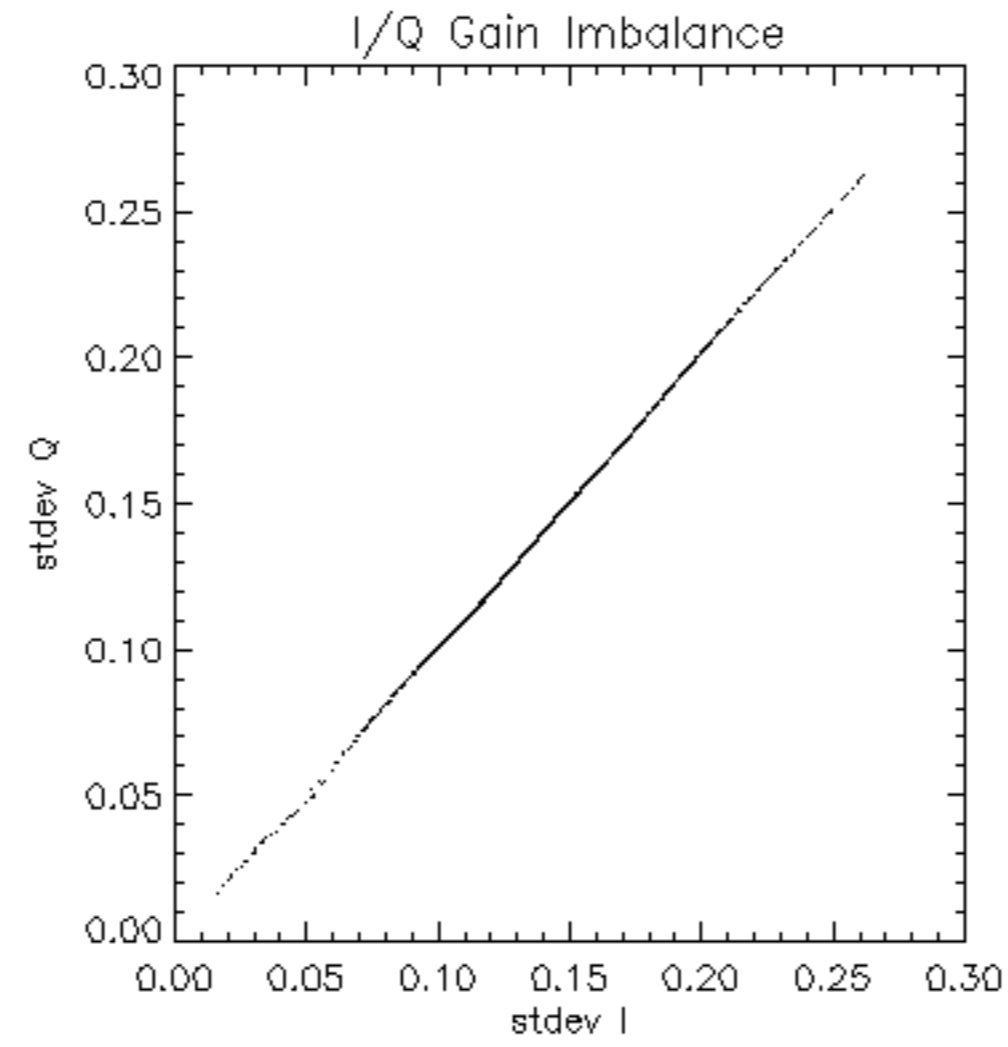


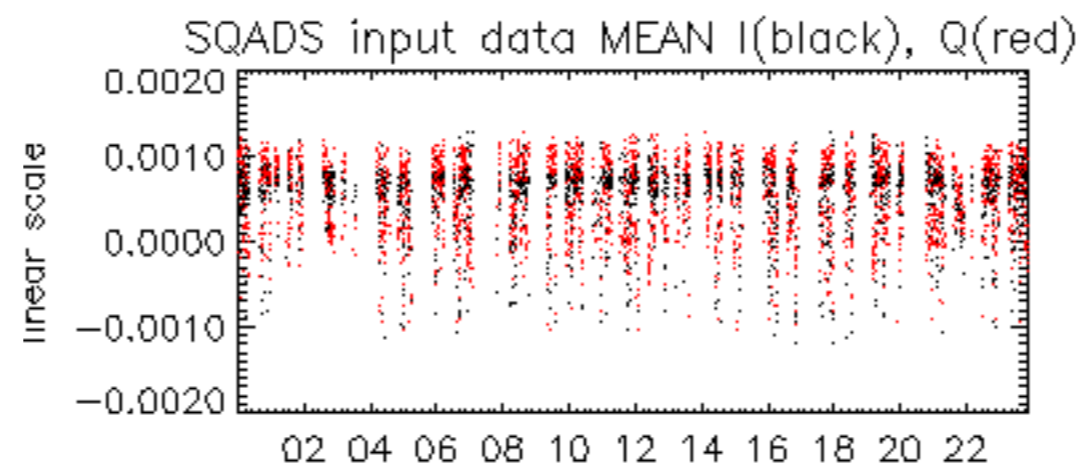


04-Jan

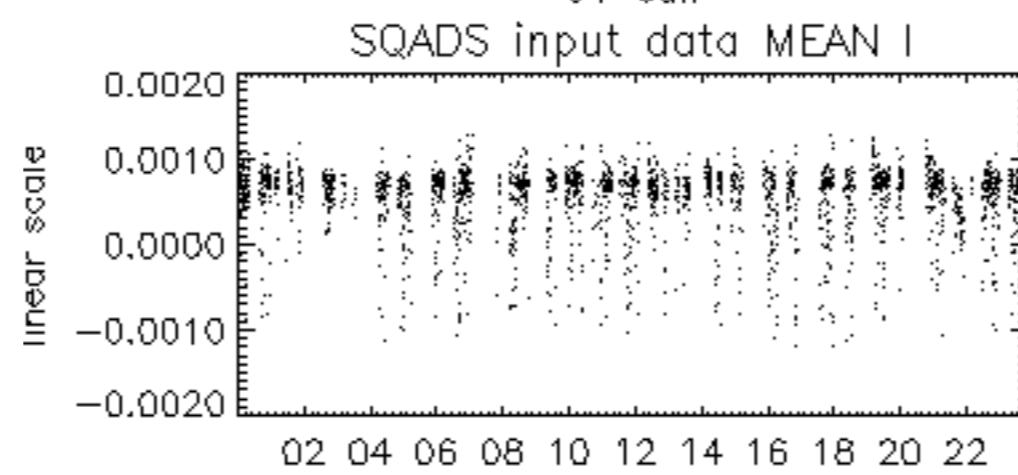


04-Jan

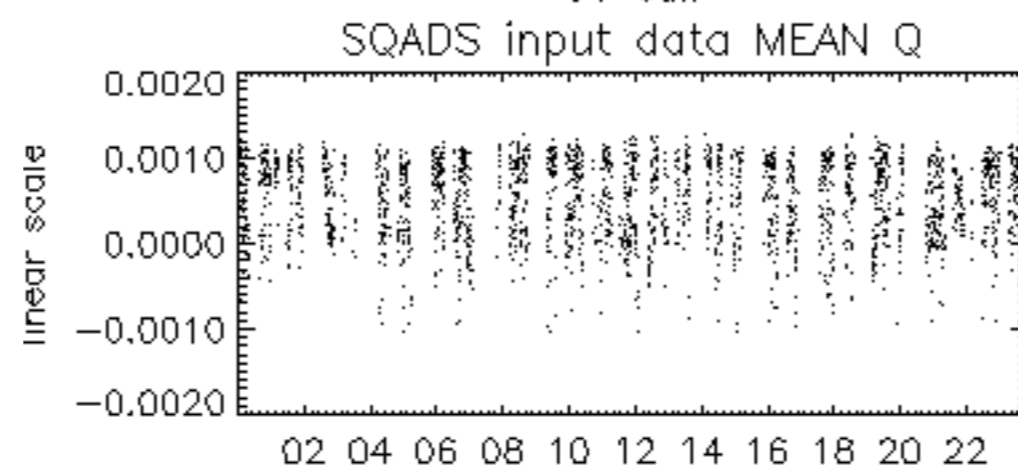


04-Jan

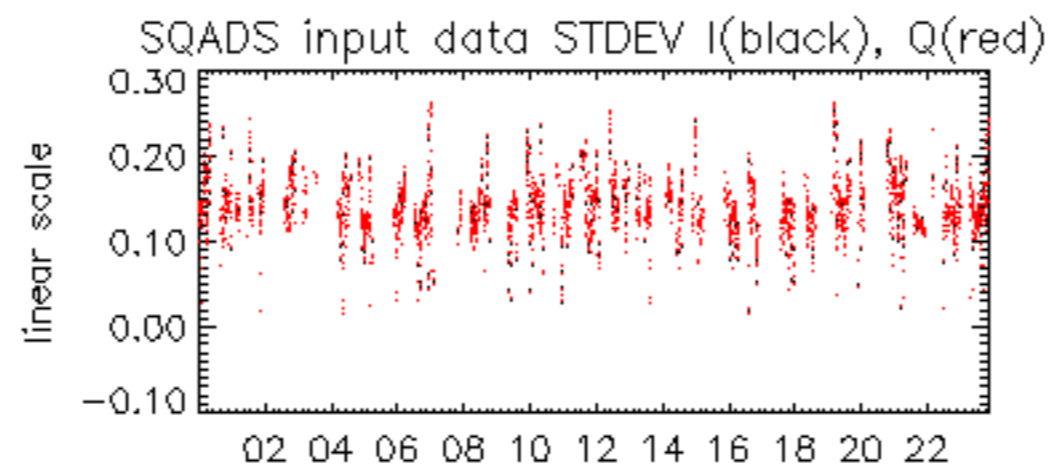

04-Jan

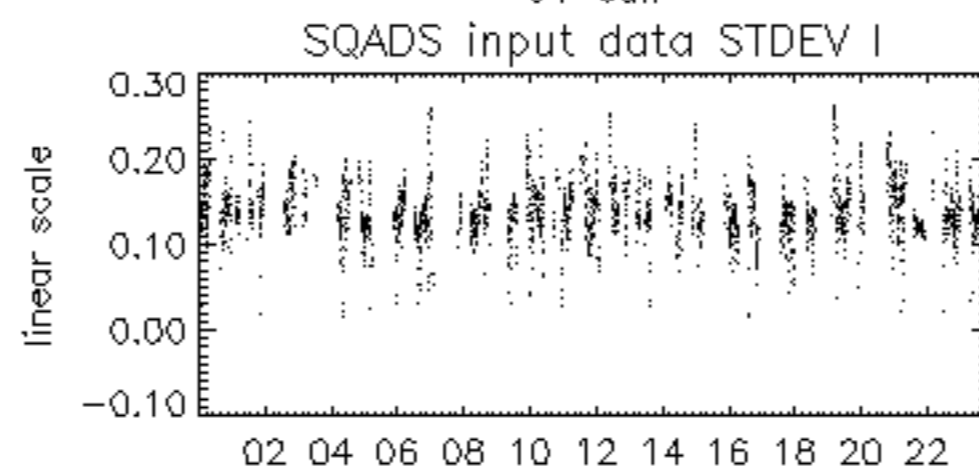

04-Jan

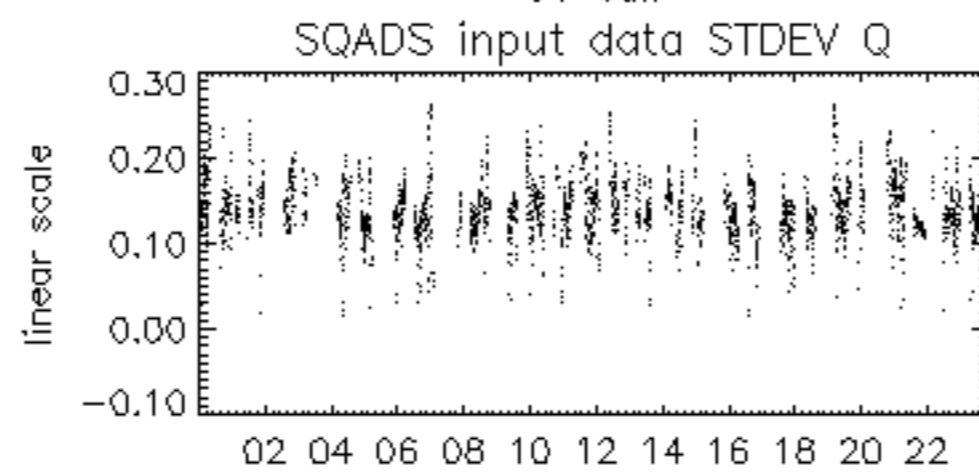

04-Jan

