



# ASAR Daily Report



Analysis from 12-MAY-2008 00:00:00 to 12-MAY-2008 23:59:59. Page generated on 13-MAY-2008 07:41:27.  
View log file: ASAR\_Daily\_Report\_20080513\_0730.log. For any anomalies please contact [mtranfaglia@serco.it](mailto:mtranfaglia@serco.it), [gscarpino@serco.it](mailto:gscarpino@serco.it).

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

## SUMMARY

1. DATA SUMMARY
  - 1.1 Summary tables
  - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
  - 2.1 IECF operational ADFs list
  - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
  - 3.1 V/V polarisation
  - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
  - 4.1 Analysis for WVS IS2 V/V
    - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
    - 4.1.2 All Rows Analysis for WVS IS2 V/V
  - 4.2 Analysis for GM1 SS3 H/H
    - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
    - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
  - 5.1 Analysis for WVS IS2 V/V
    - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
    - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
  - 5.2 Analysis for GM1 SS1 H/H
    - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
    - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
  - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
  - 6.1 Analysis for WSM SS1 H/H
    - 6.1.1 ScaleFactor
  - 6.2 Analysis for WSM SS1 V/V
    - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
  - 7.1 Analysis for WVS
  - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
  - 8.1 Number of Missing Lines
  - 8.2 Number of Gaps

---

## 1 - DATA SUMMARY

### 1.1 - Summary tables

[ [BACK TO MENU](#) ]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	3	PDE	WS	H/H	37	PDE	IS1	H/H	2	PDE	IS2	***	2	PDE	WS	H/H	9	PDE	2008-05-12 01:59:23	H	320
PDE	IS2	V/V	28	PDK	WS	H/H	40	PDE	IS1	V/H	1	PDE	IS2	H/H	25	PDE	WS	V/V	7	PDK	2008-05-12 08:41:47	V	320
PDK	IS2	V/V	24					PDE	IS3	H/V	2	PDE	IS2	V/V	18								
								PDE	IS4	H/H	1	PDE	IS4	V/V	1								
								PDE	IS4	V/H	1	PDE	IS6	H/H	4								
								PDE	IS6	H/H	1	PDE	IS6	V/V	1								
								PDE	IS7	H/H	1	PDK	IS2	H/H	5								
								PDK	IS4	H/H	1	PDK	IS2	V/V	5								
												PDK	IS3	H/H	1								
												PDK	IS7	V/V	1								

## 1.2 - Lists of products used

[ [BACK TO MENU](#) ]

[[TXT](#)] [[XLS](#)] [List\\_WVS\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_GM1\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_APM\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_IMM\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_WSM\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_MS\\_products\\_used](#)

## 2 - AUXILIARY FILES ANALYSIS

### 2.1 - IECF operational ADFs list

[ [BACK TO MENU](#) ]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20071218_084201_20070204_165113_20081231_000000
ASA_INS_AXVIEC20071218_083603_20070307_060000_20081231_000000
ASA_XCH_AXVIEC20051219_162547_20020301_000000_20081231_000000
ASA_XCA_AXVIEC20071218_082742_20070204_165113_20081231_000000

### 2.2 - Products with wrong ADFs



[ [BACK TO MENU](#) ]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0

[[TXT](#)] [[XLS](#)] [Check\\_ADFs\\_WVS](#)  
 [[TXT](#)] [[XLS](#)] [Check\\_ADFs\\_GM1](#)  
 [[TXT](#)] [[XLS](#)] [Check\\_ADFs\\_APM](#)

### 3 - MODULE STEPPING PRODUCTS ANALYSIS



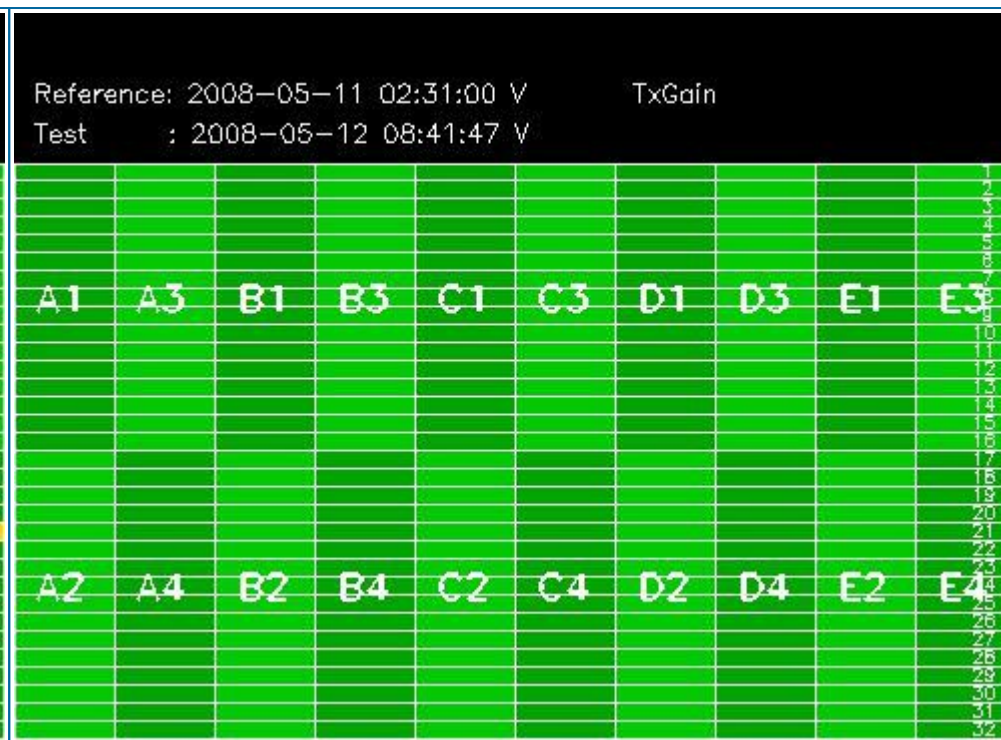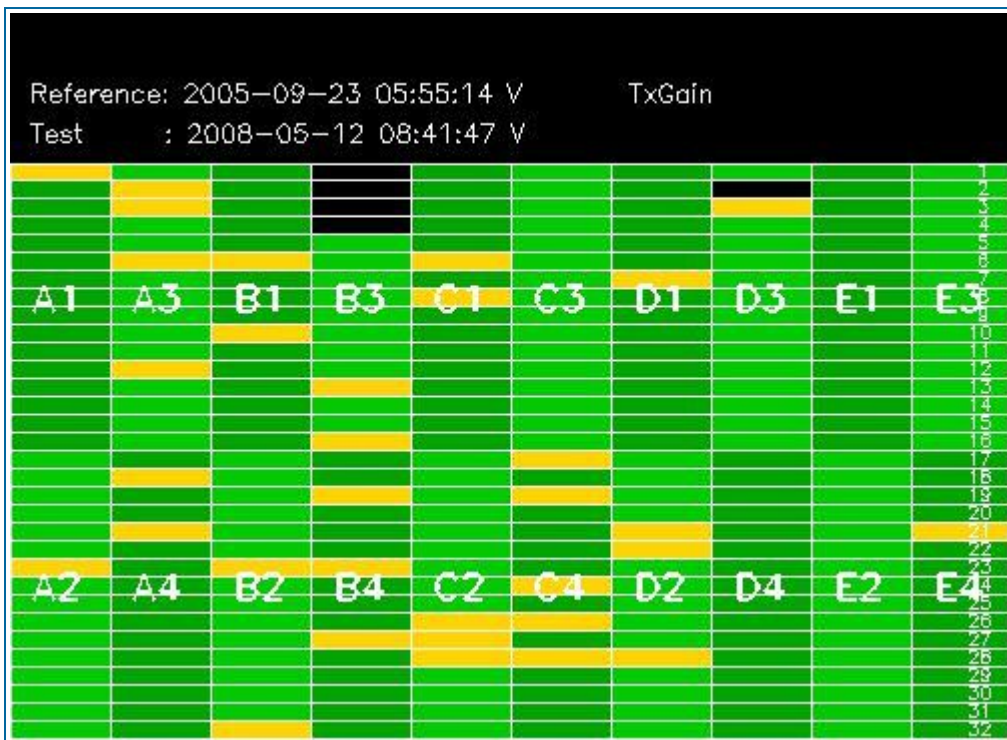

### 3.2 - H/H polarisation


[ [BACK TO MENU](#) ]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
After antenna maintenance (2005-09-22/23)	Previous product in the same polarisation

Reference: 2005-09-22 06:26:51 H RxGain  
 Test : 2008-05-12 01:59:23 H



Reference: 2008-05-10 03:02:37 H RxGain  
 Test : 2008-05-12 01:59:23 H

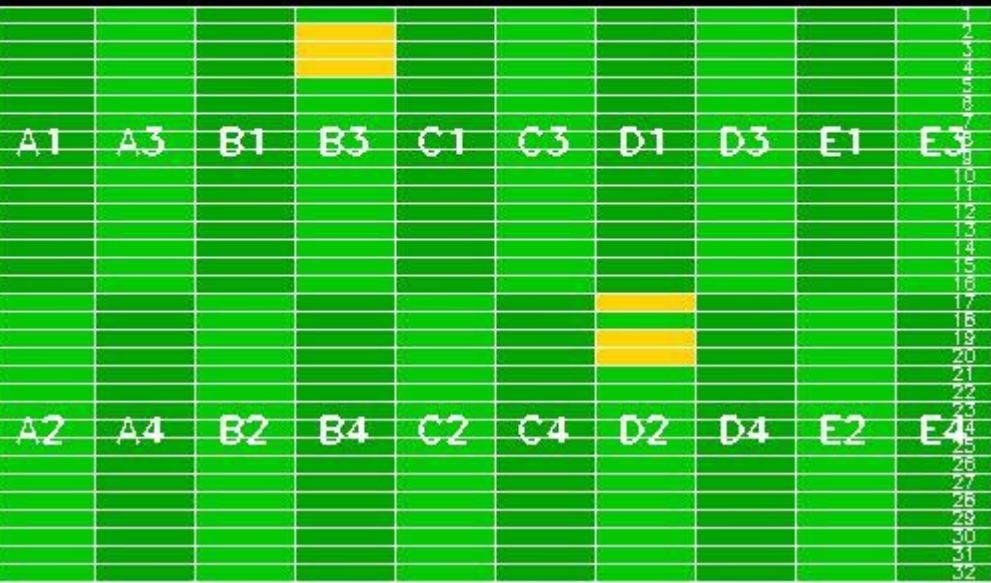

Reference: 2005-09-22 06:26:51 H RxPhase  
 Test : 2008-05-12 01:59:23 H



Reference: 2008-05-10 03:02:37 H RxPhase  
 Test : 2008-05-12 01:59:23 H





## 4 - CALIBRATION PULSES ANALYSIS

### 4.1 - Analysis for WVS IS2 V/V


#### 4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[ BACK TO MENU ]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]


Calibration pulses for WVS IS2 V/V

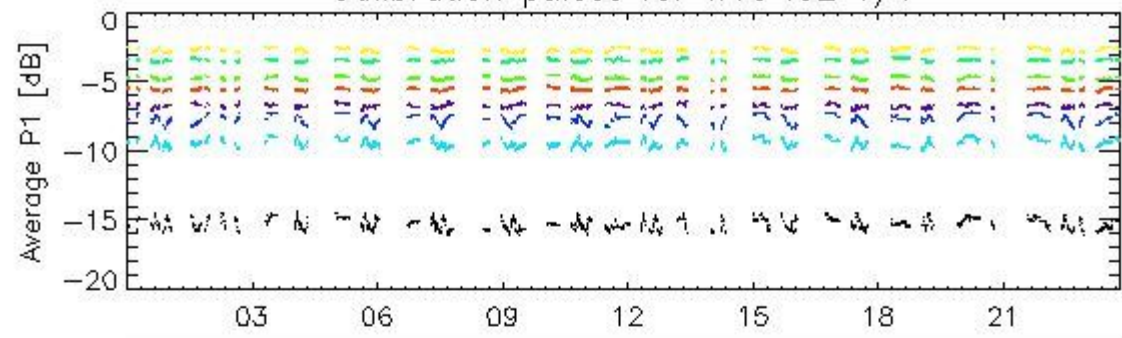


12-May

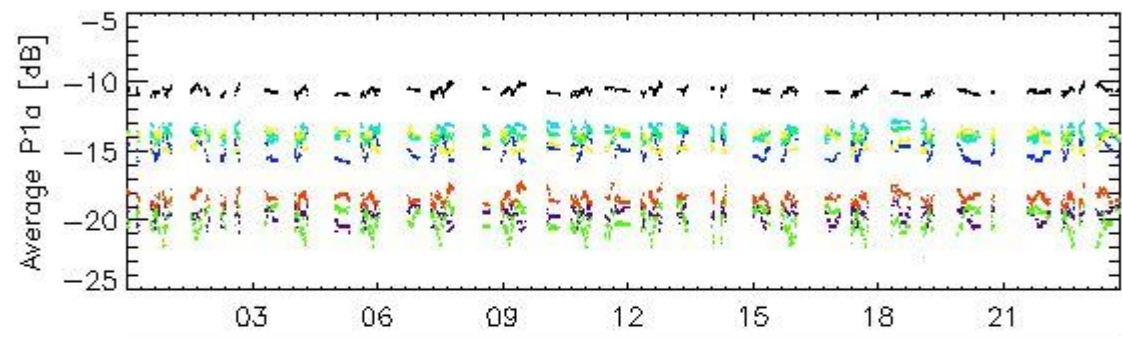

12-May

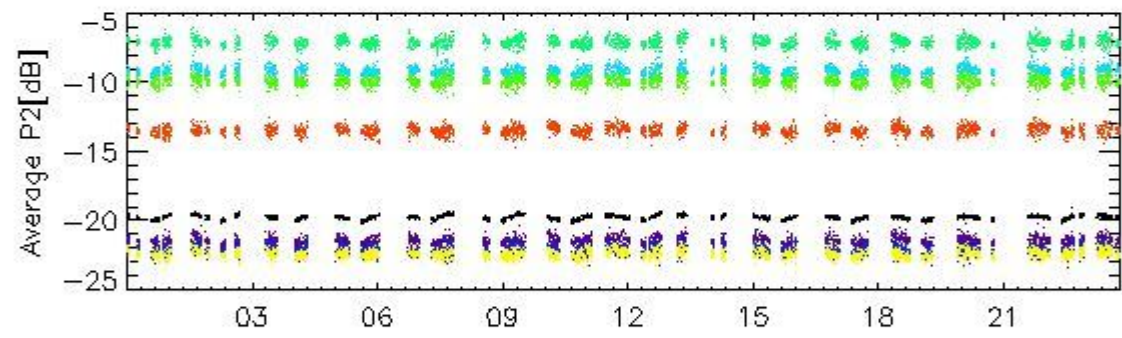


12-May

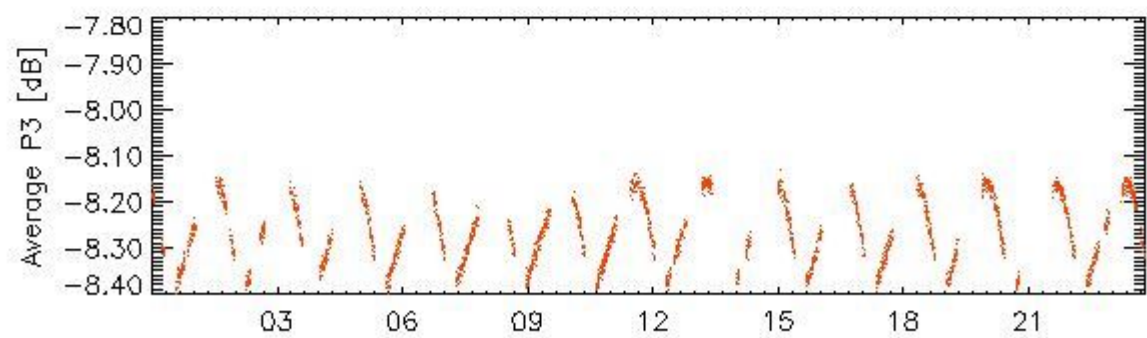

12-May


rows: \_ 1 \_ 5 \_ 9 \_ 13 \_ 17 \_ 21 \_ 25 \_ 29

Transmit power (P1 - P1a) for WVS IS2 V/V

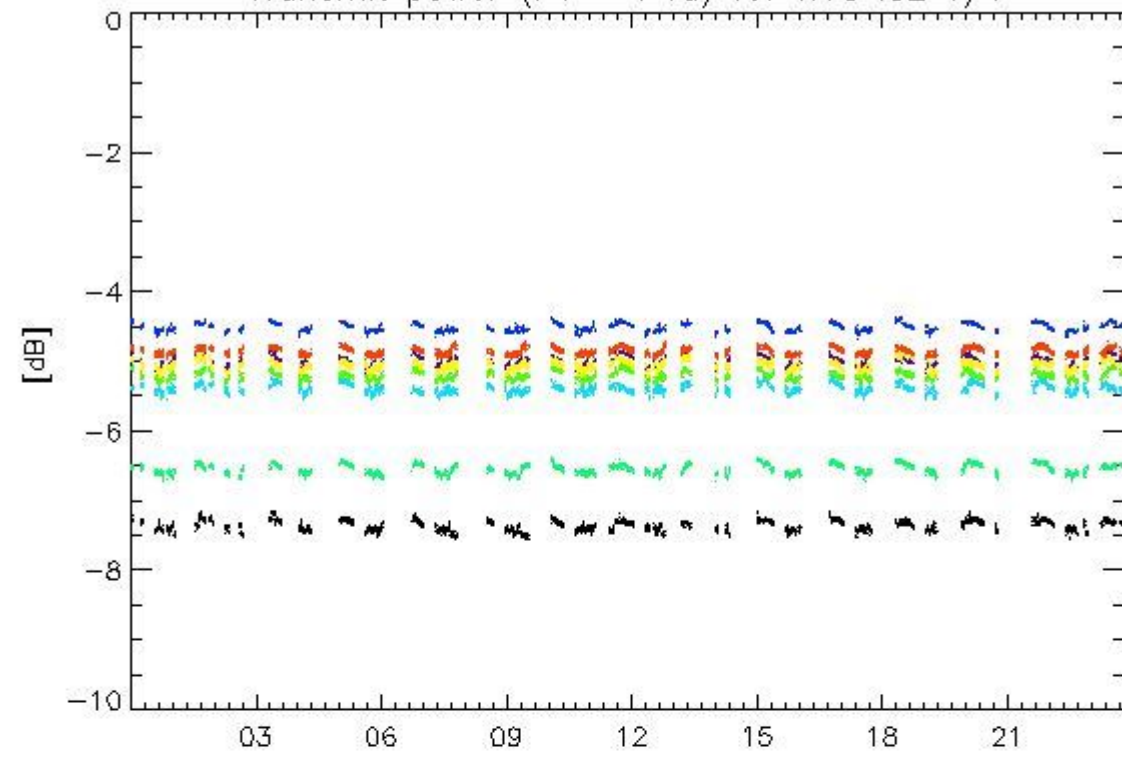

12-May

Transmit power (P1 - P1a) for WVS IS2 V/V

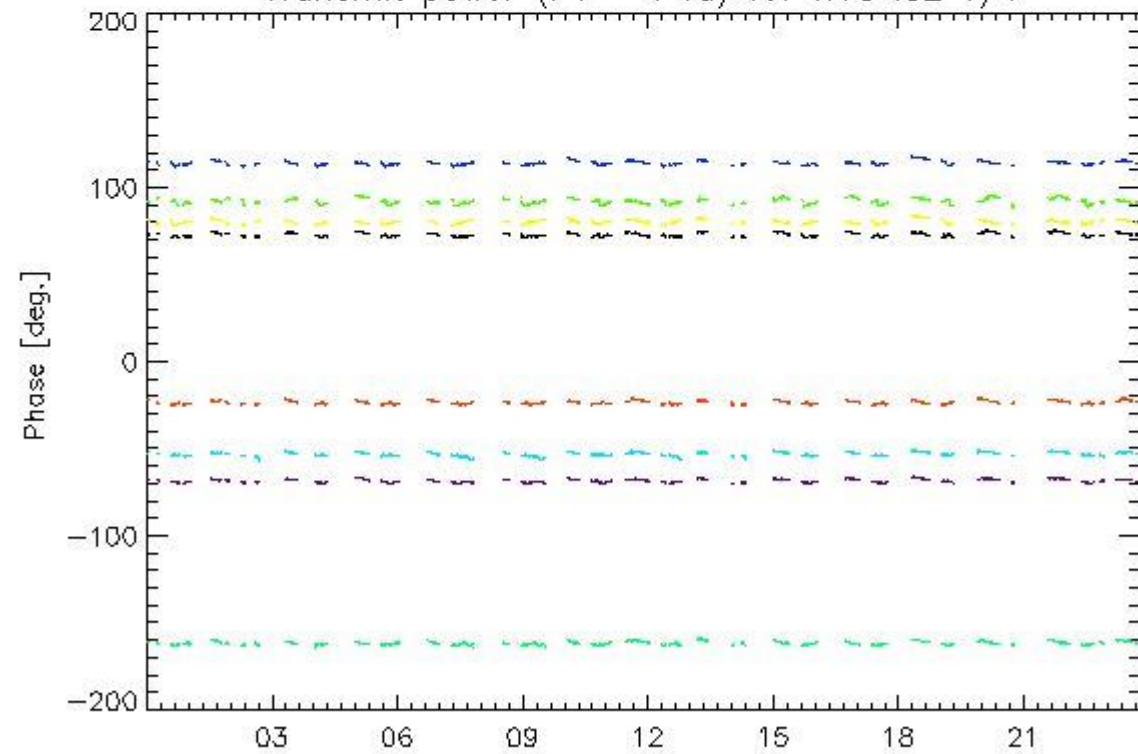


12-May

rows: \_ 1 \_ 5 \_ 9 \_ 13 \_ 17 \_ 21 \_ 25 \_ 29

#### 4.1.2 - All Rows Analysis for WVS IS2 V/V

[ [BACK TO MENU](#) ]



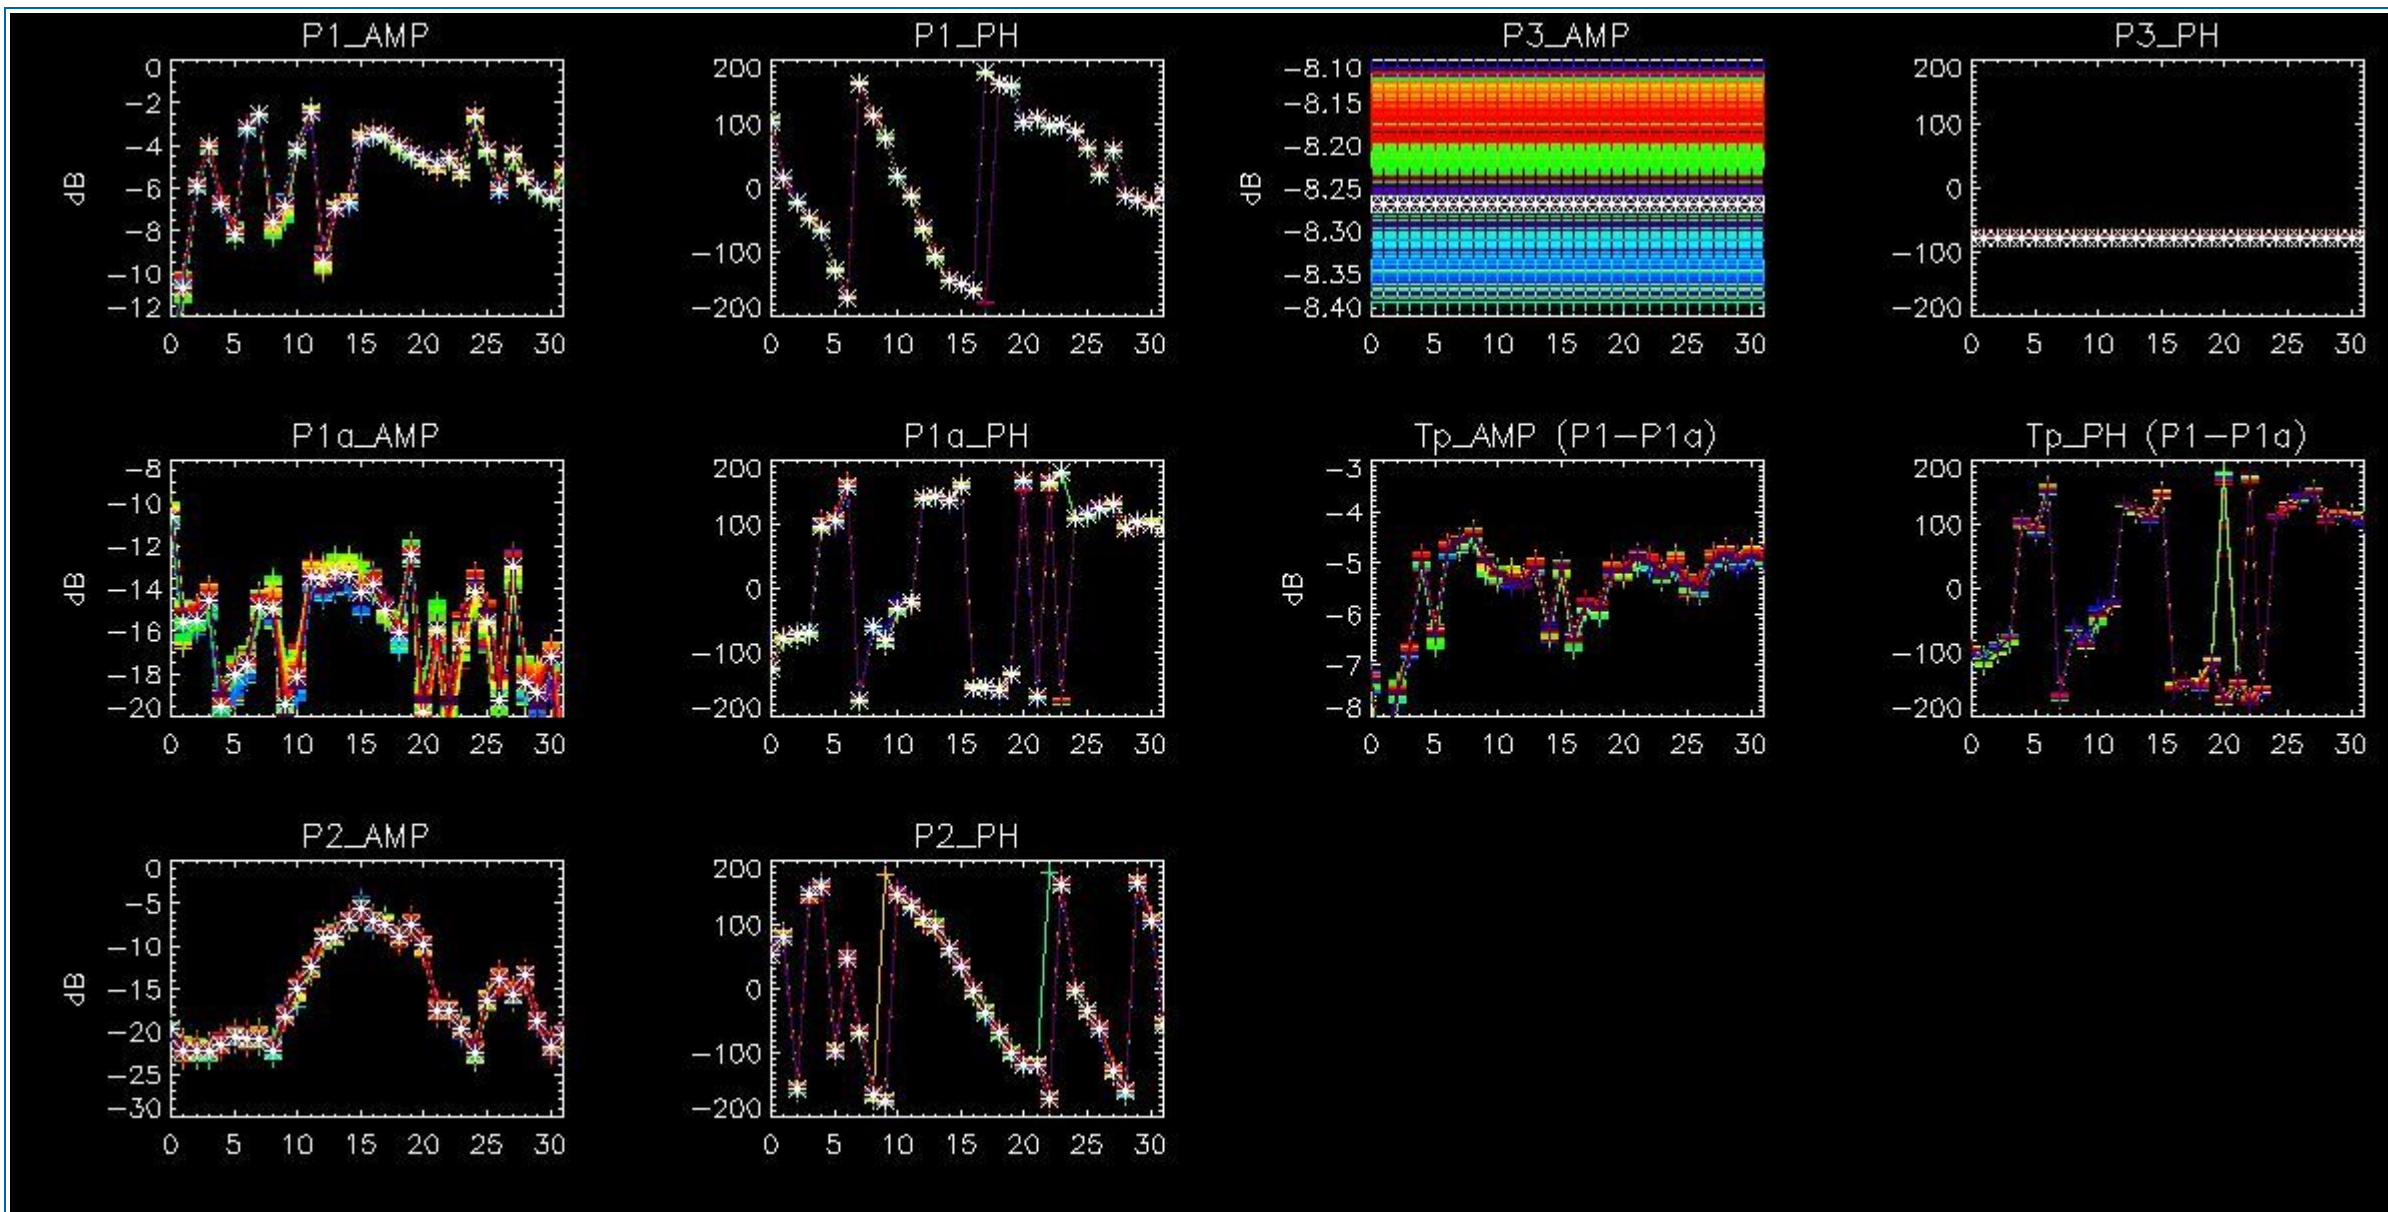

## 4.2 - Analysis for GM1 SS3 H/H

### 4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H


[ BACK TO MENU ]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]



Calibration pulses for GM1 SS3 H/H

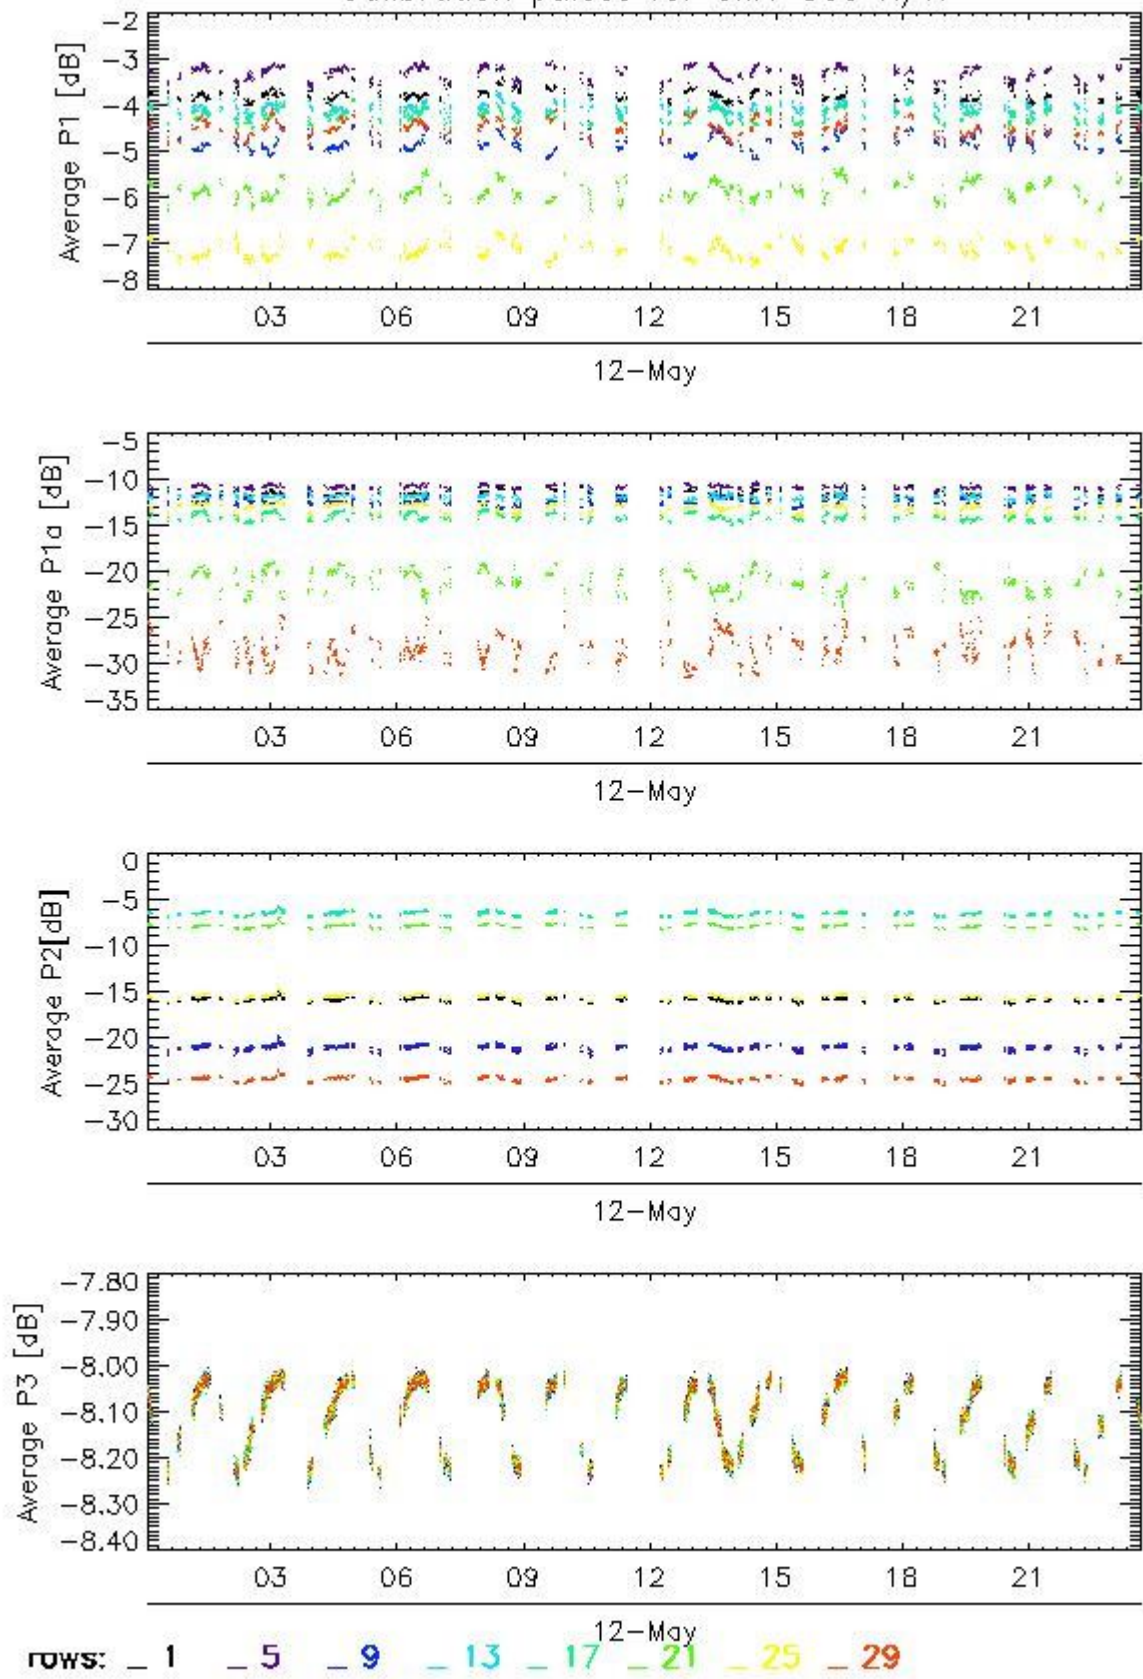


Transmit power (P1 - P1a) for GM1 SS3 H/H

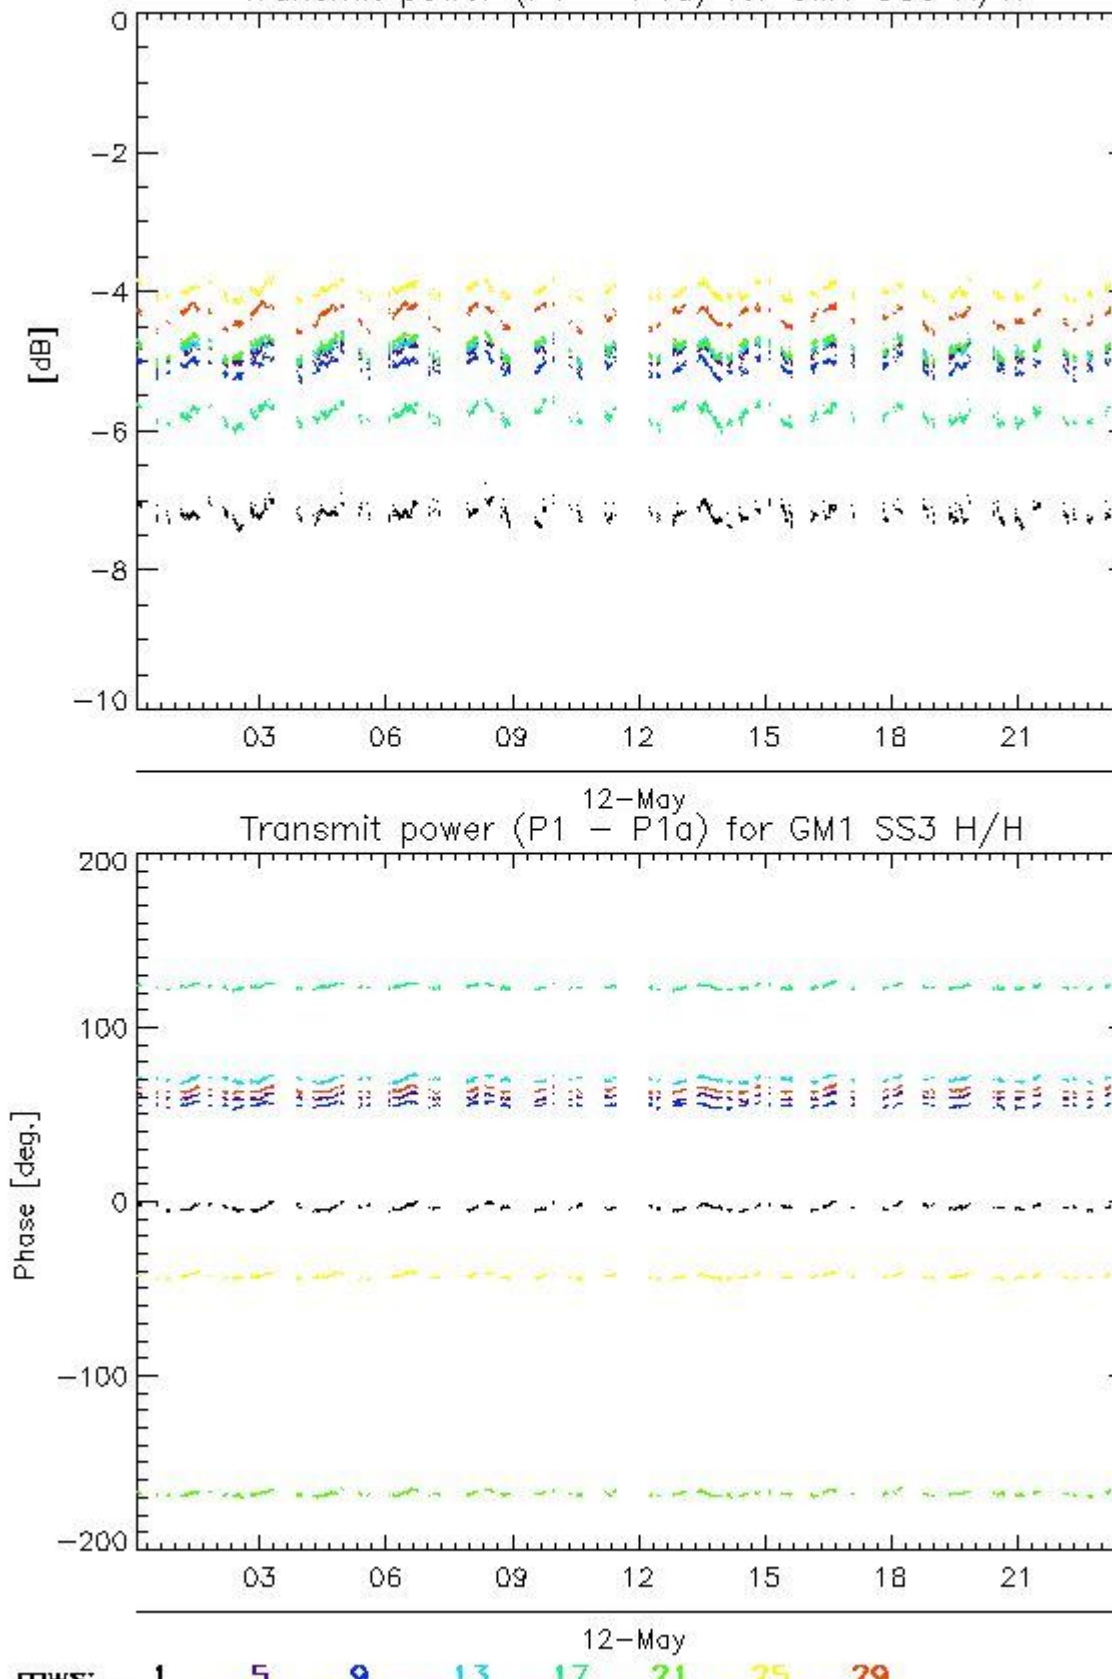

#### 4.2.2 - All Rows Analysis for GM1 SS3 H/H

[ [BACK TO MENU](#) ]



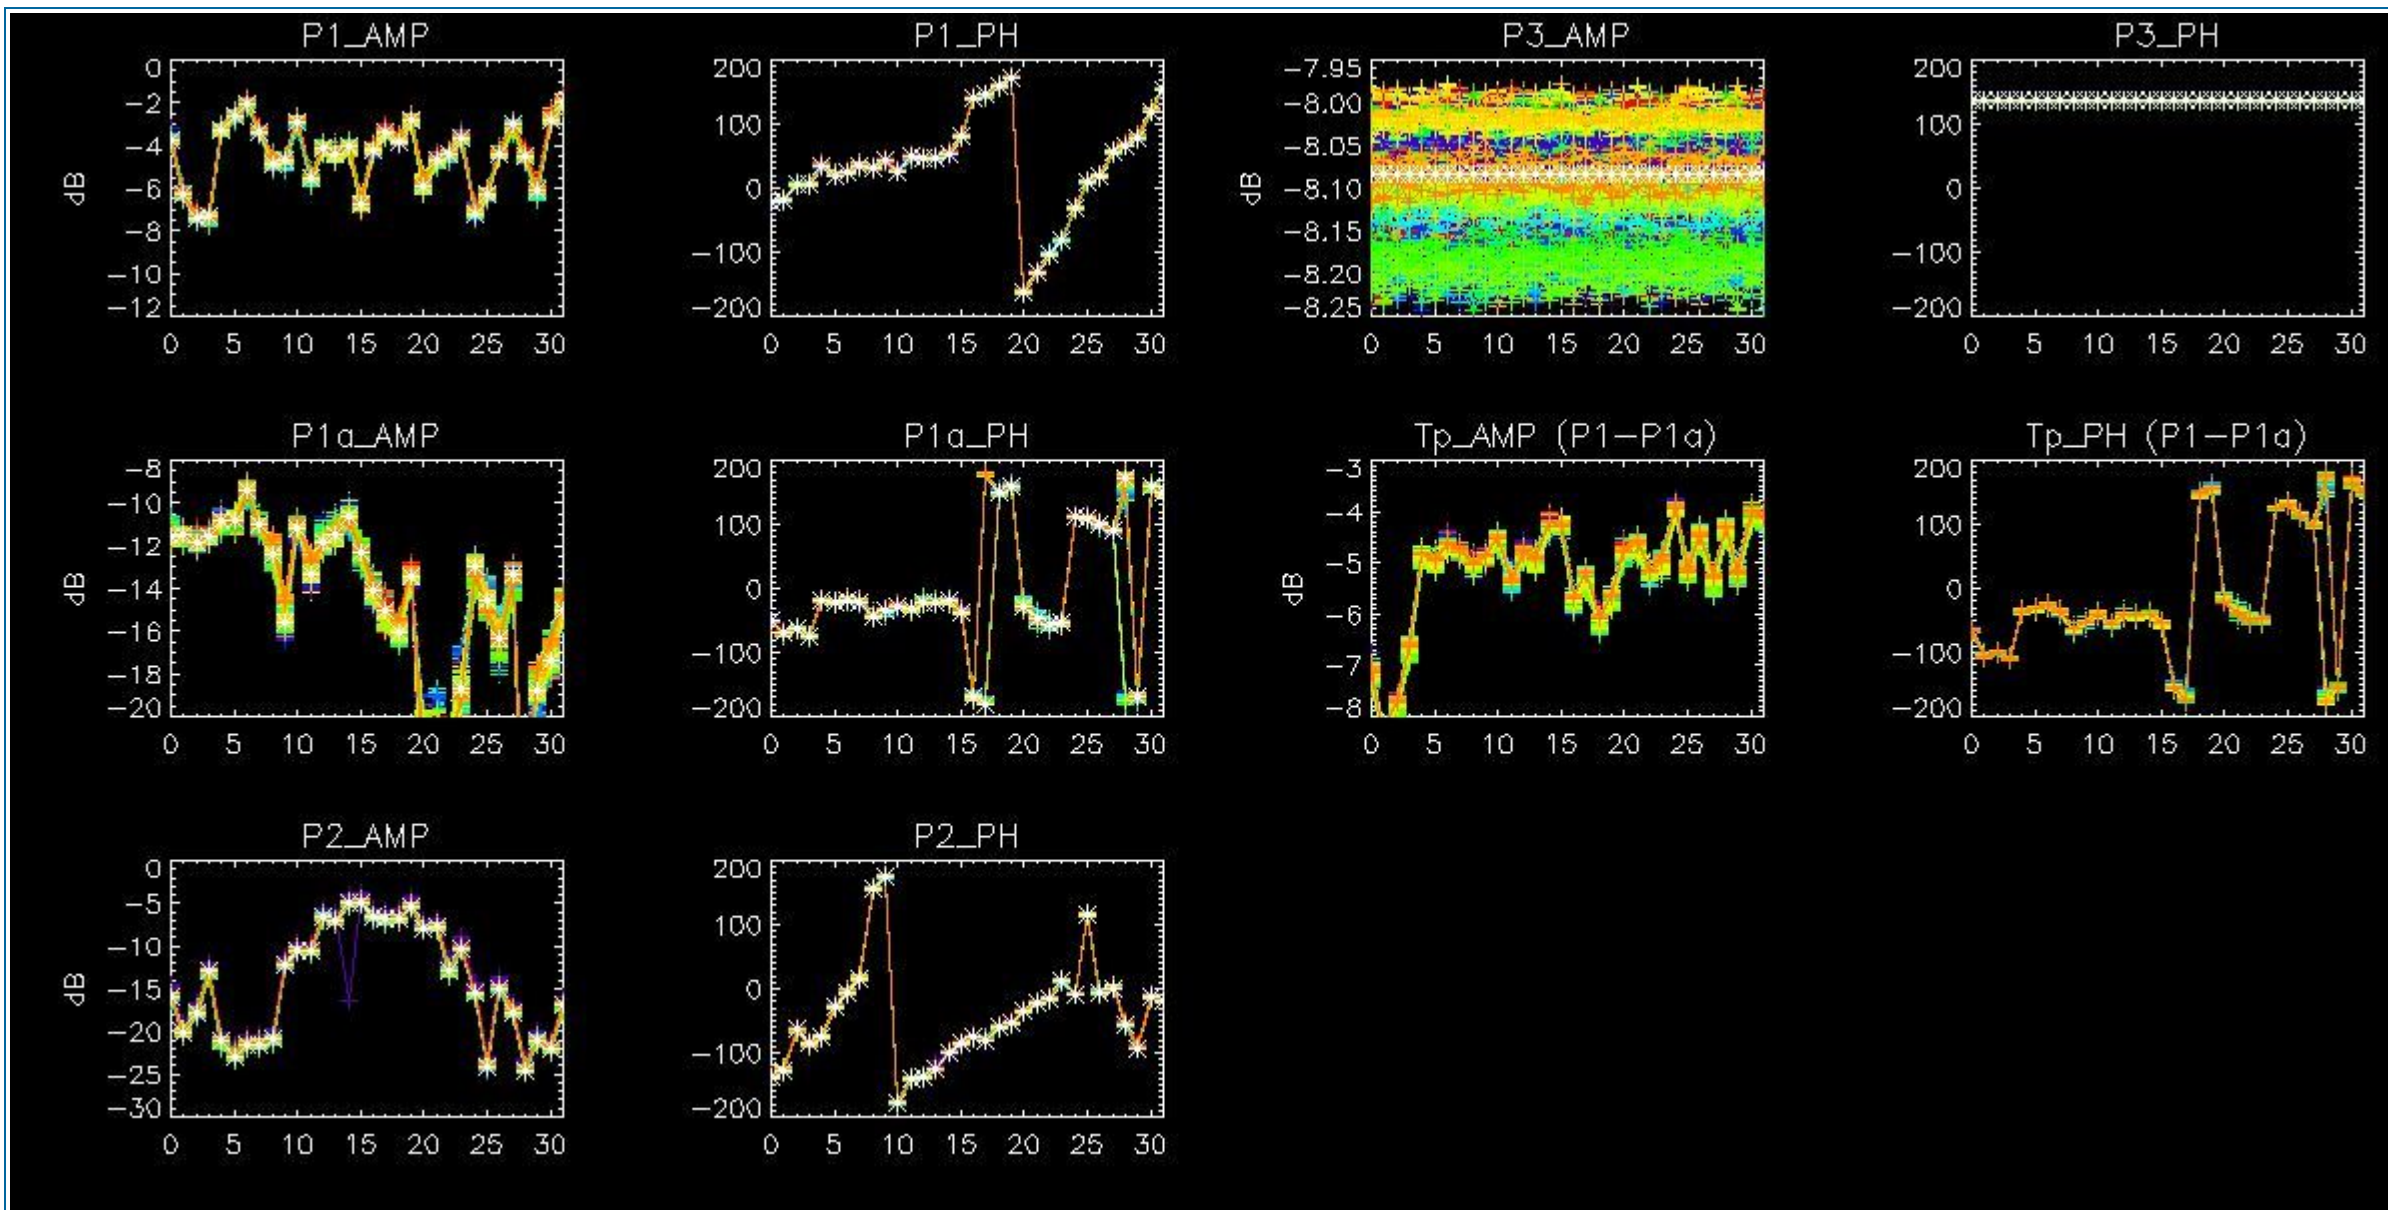


## 5 - DOPPLER ANALYSIS

### 5.1 - Analysis for WVS IS2 V/V

#### 5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[ [BACK TO MENU](#) ]




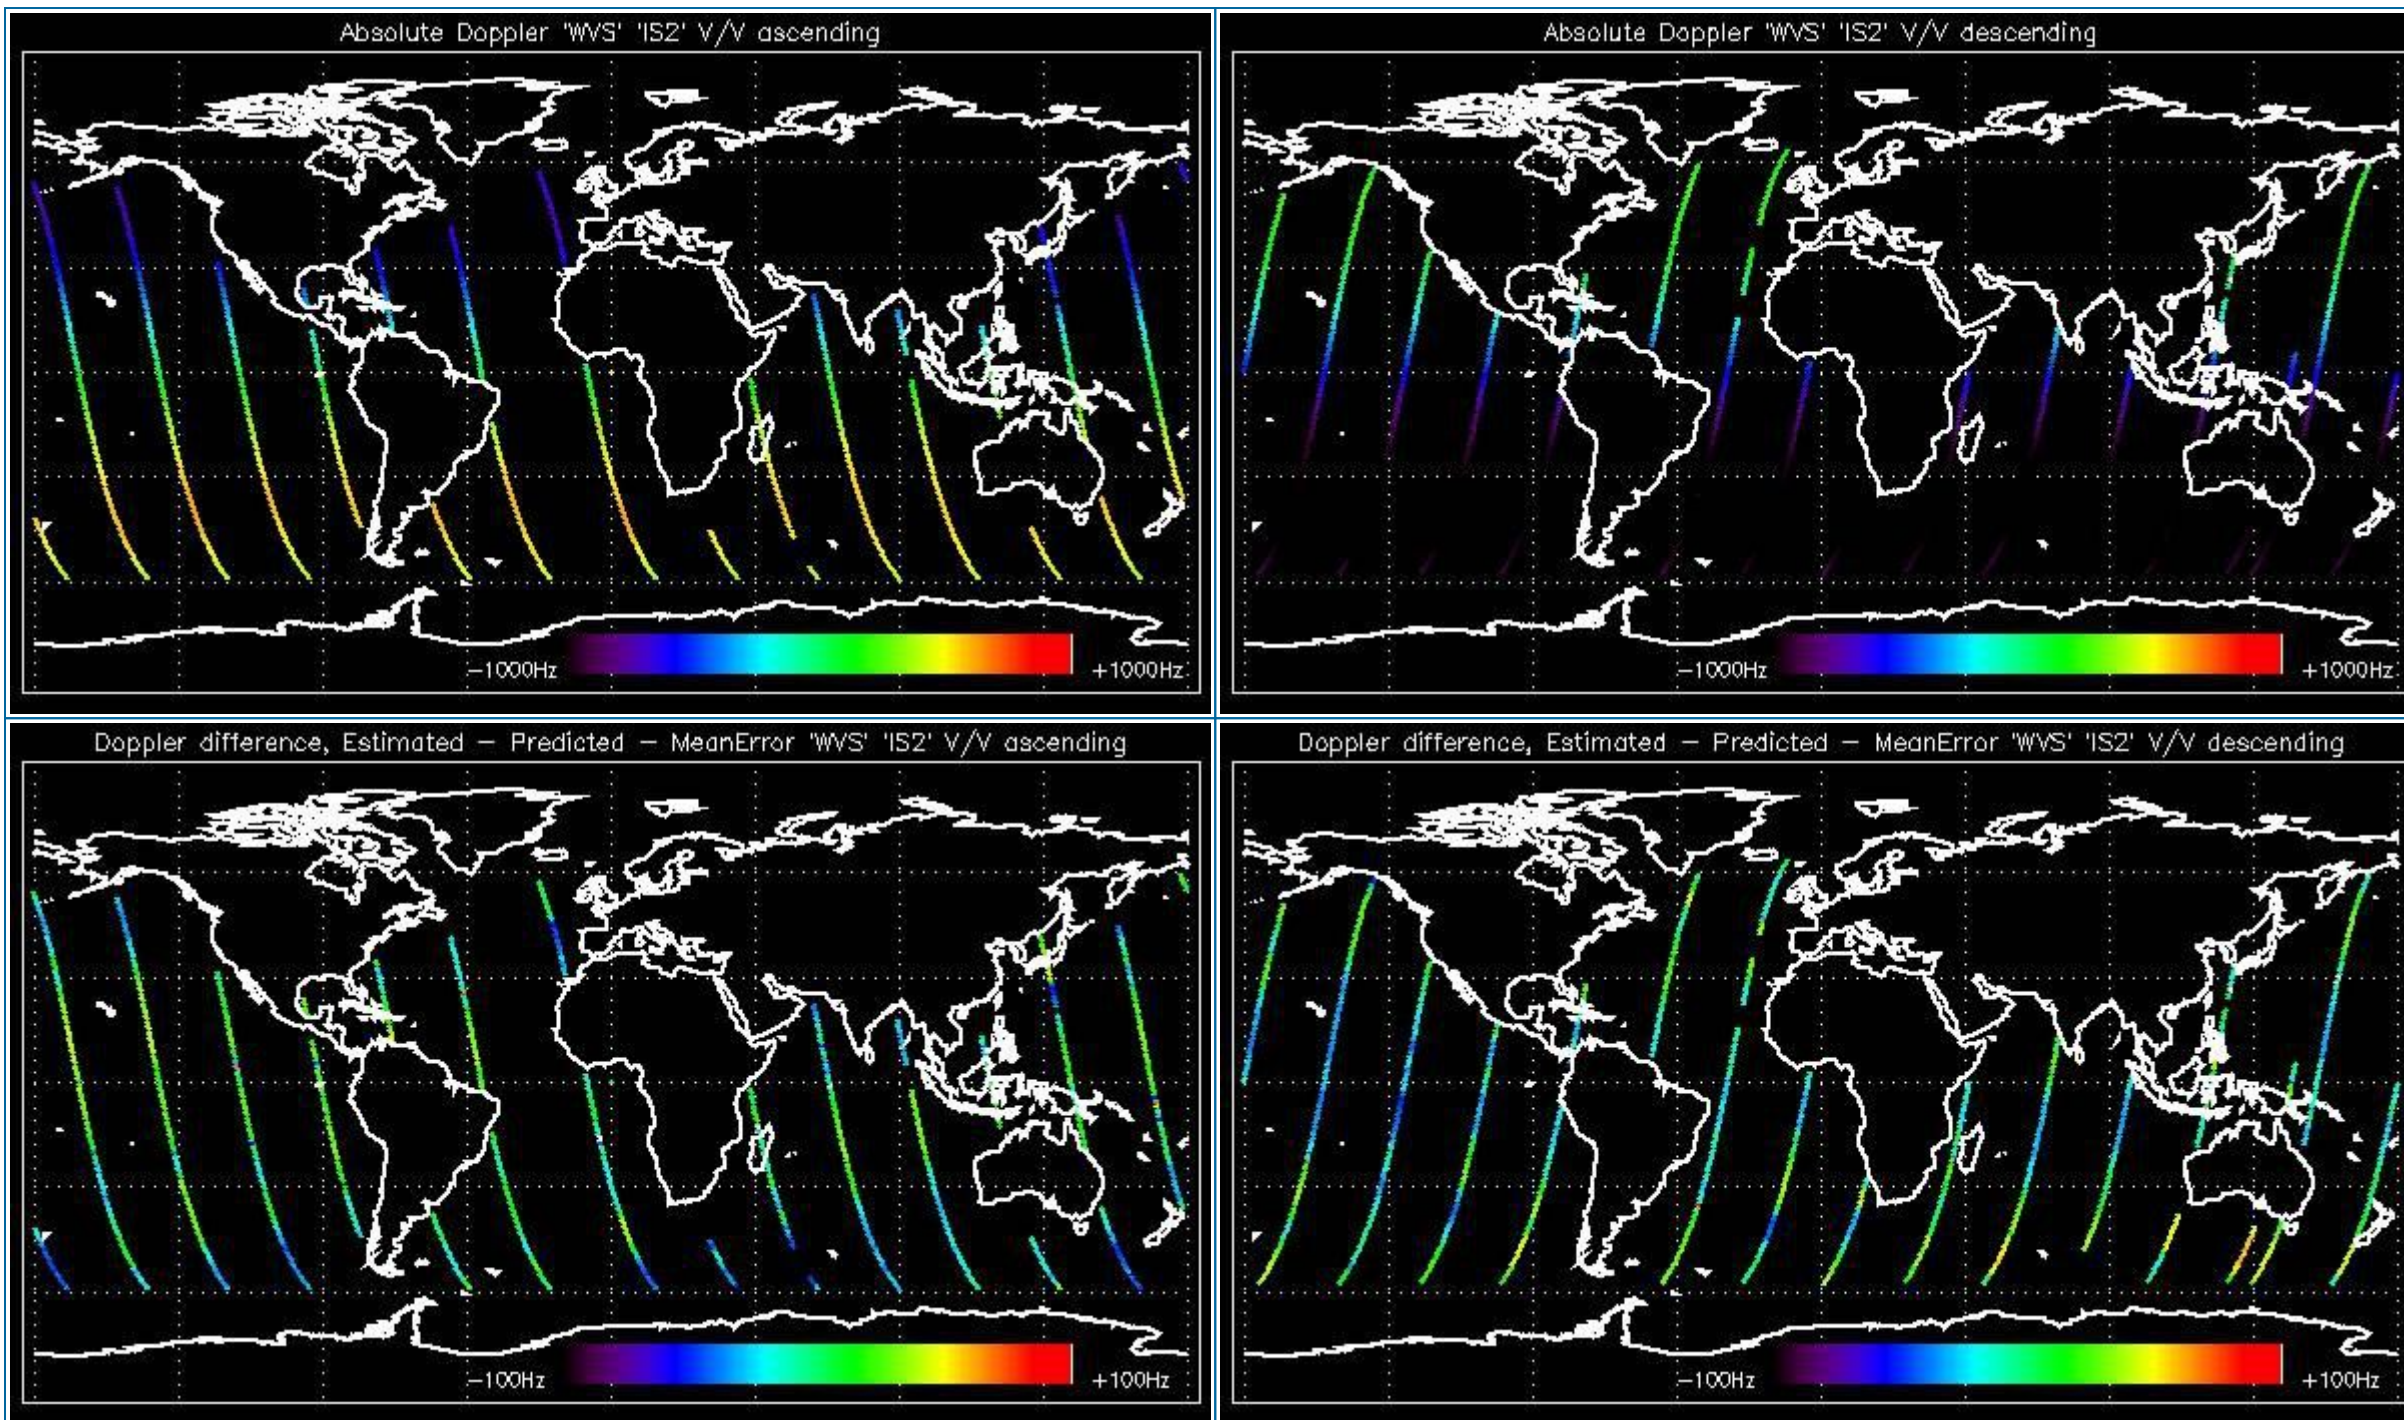

### 5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[ [BACK TO MENU](#) ]



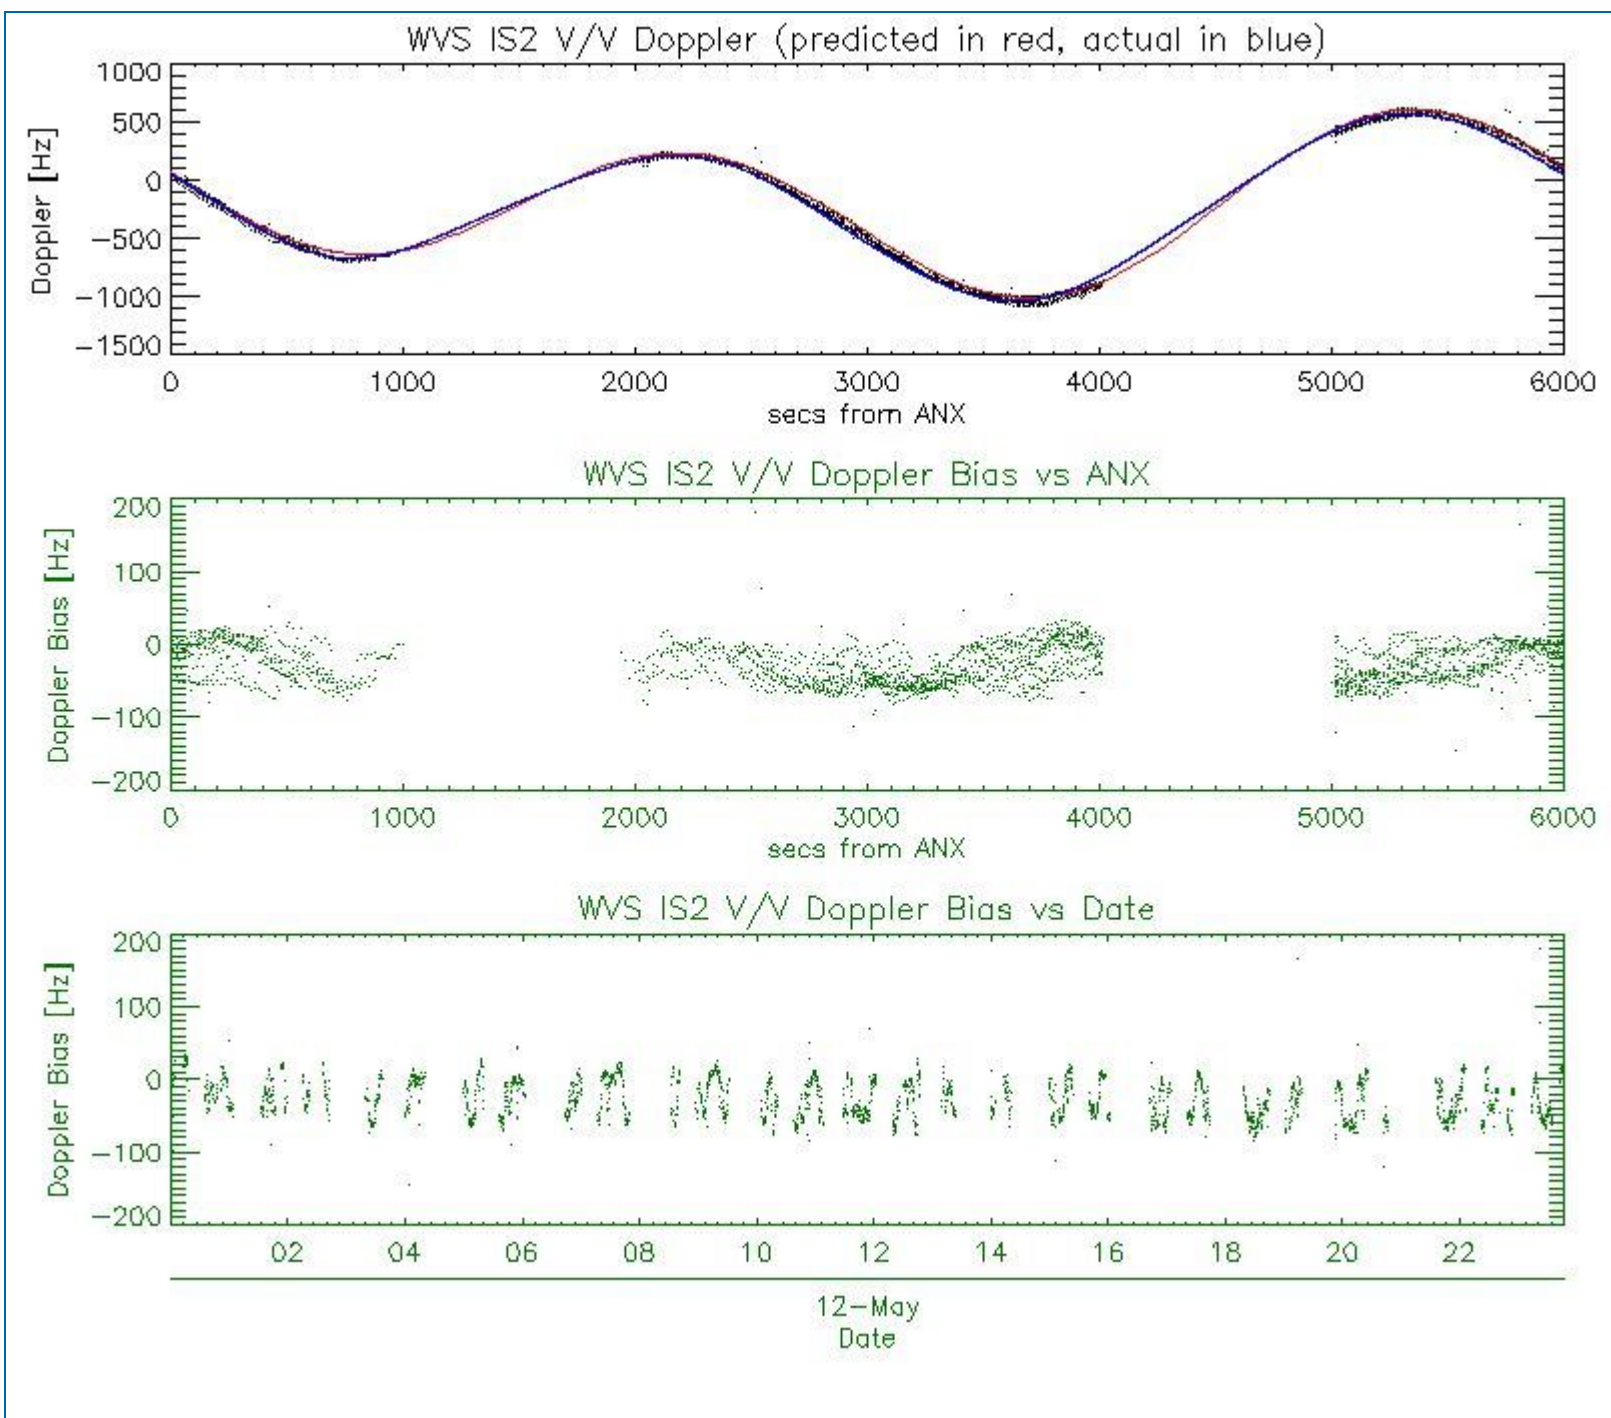


## 5.2 - Analysis for GM1 SS1 H/H

### 5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[ [BACK TO MENU](#) ]




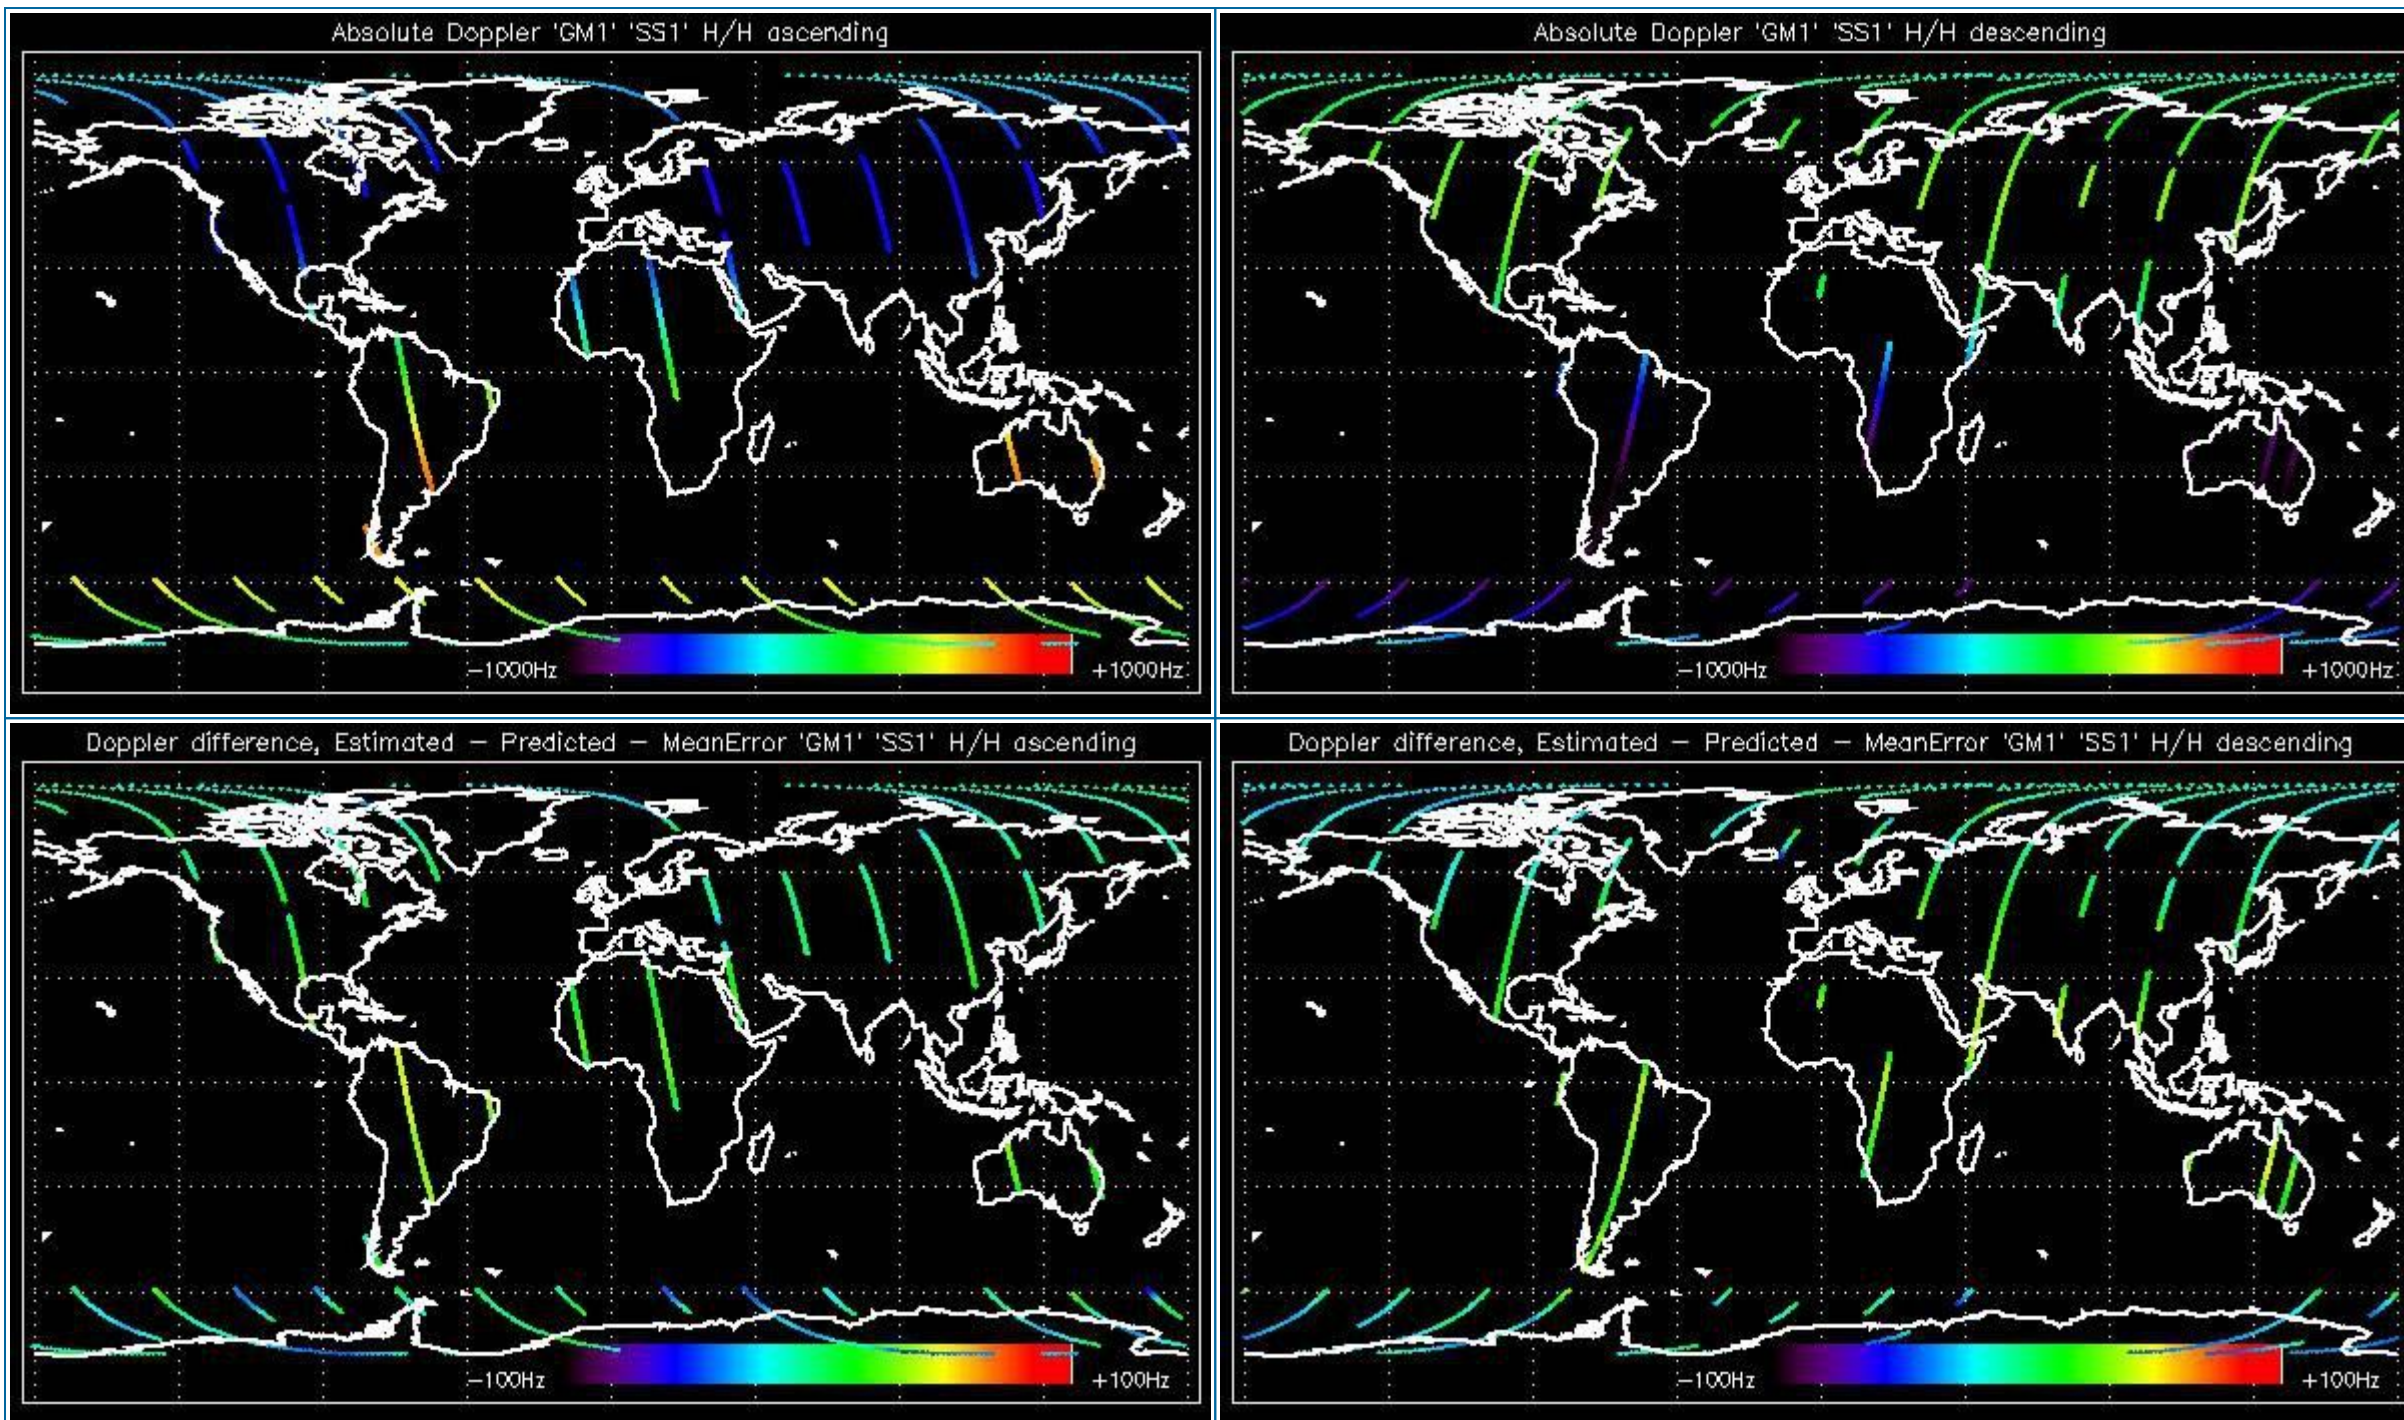

### 5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[ [BACK TO MENU](#) ]




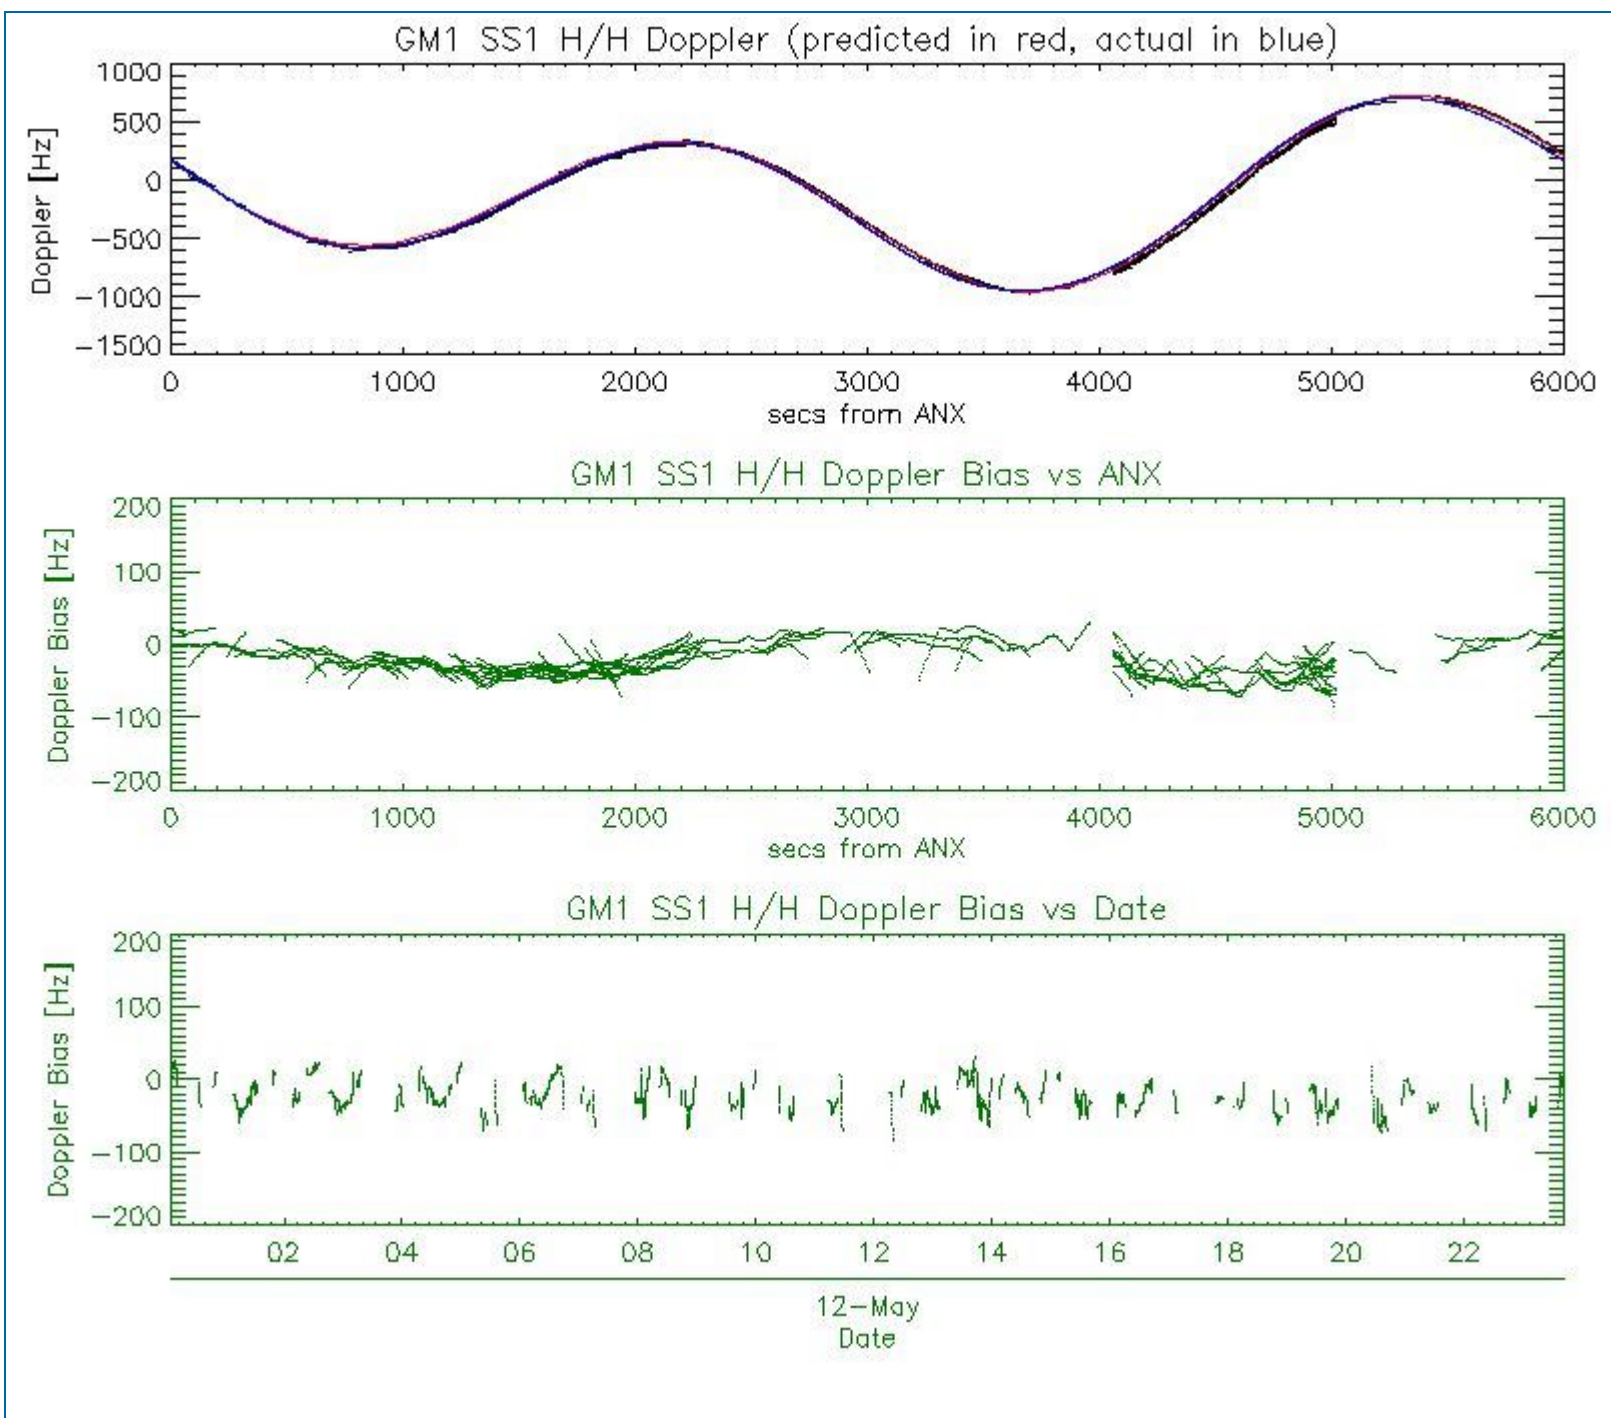

### 5.3 - Doppler JUMPS Analysis for WSM

[ BACK TO MENU ]



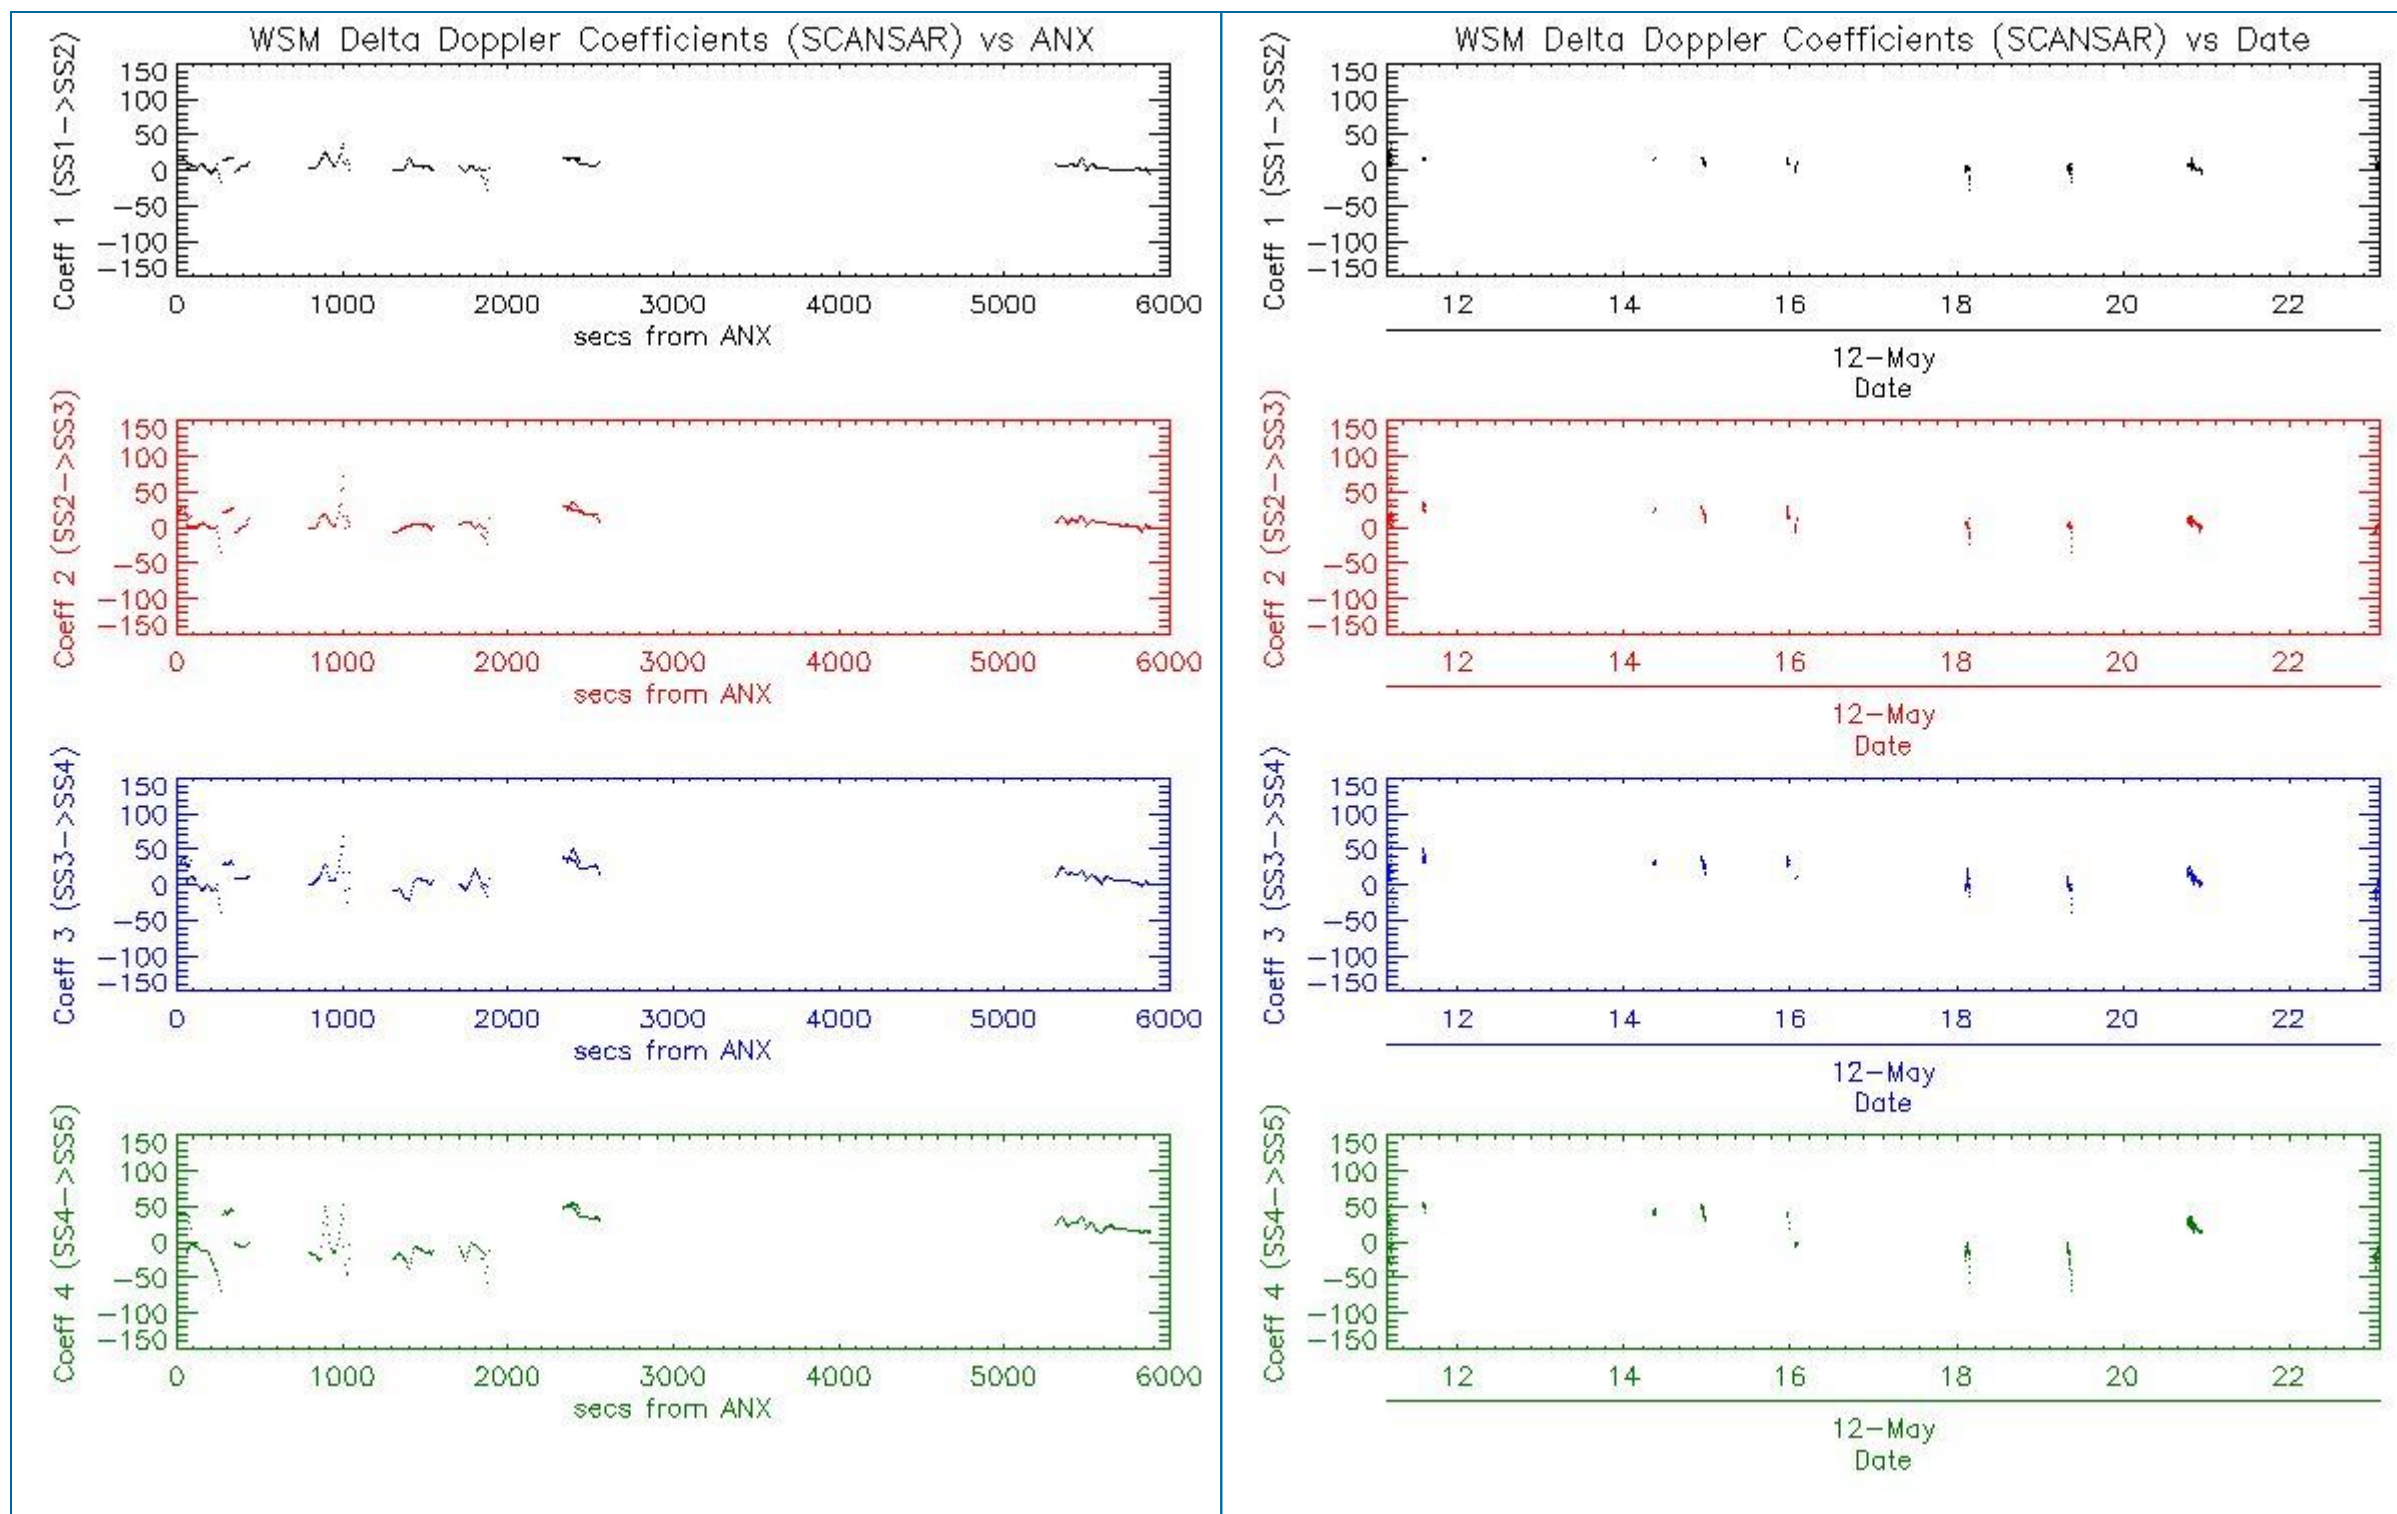



## 6 - CHIRP ANALYSIS

### 6.1 - Analysis for WSM SS1 H/H

#### 6.1.1 - ScaleFactor

[ [BACK TO MENU](#) ]





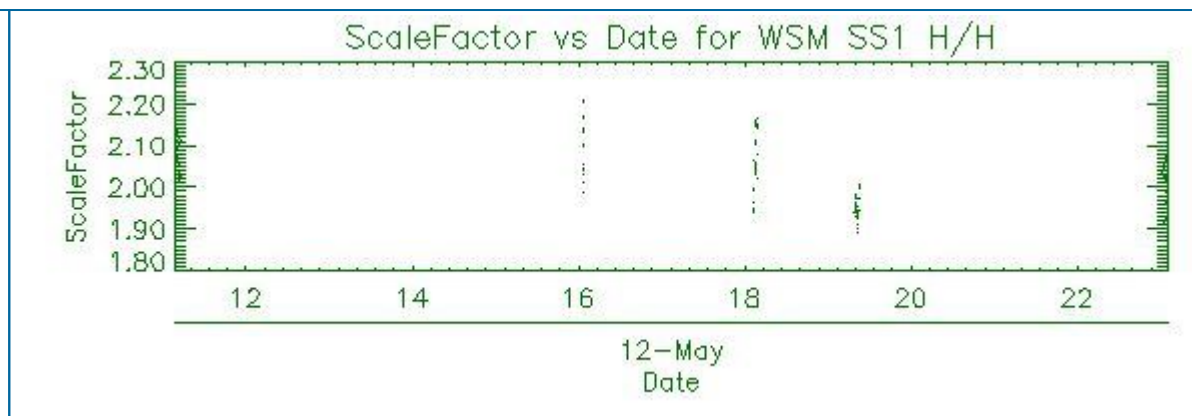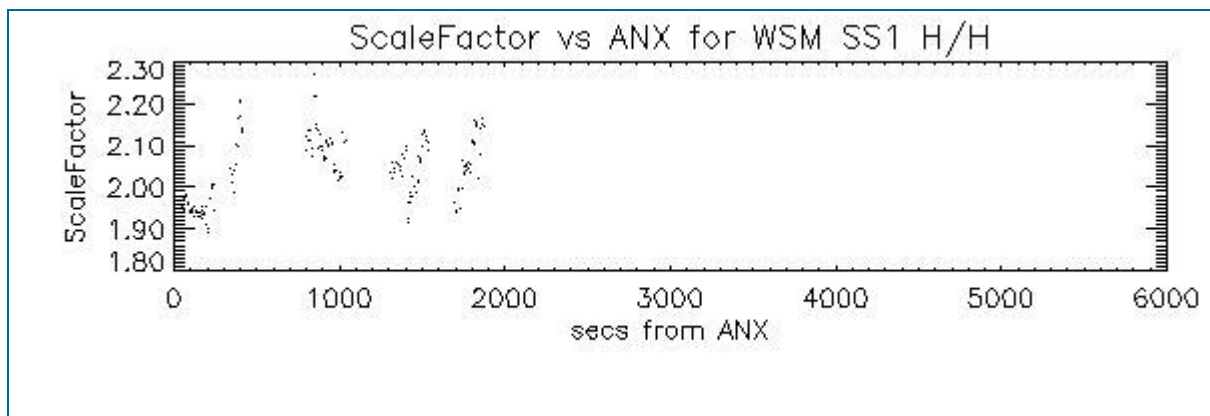

## 6.2 - Analysis for WSM SS1 V/V

### 6.2.1 - ScaleFactor

[ [BACK TO MENU](#) ]

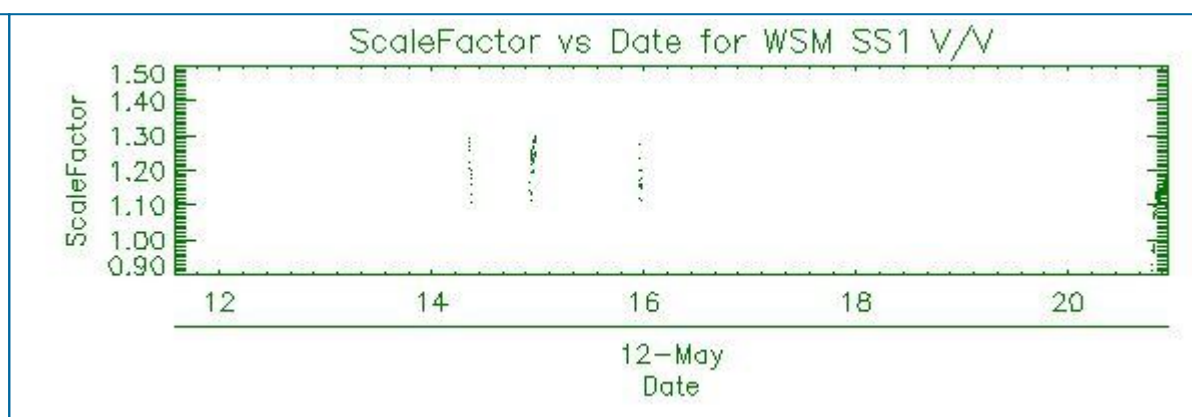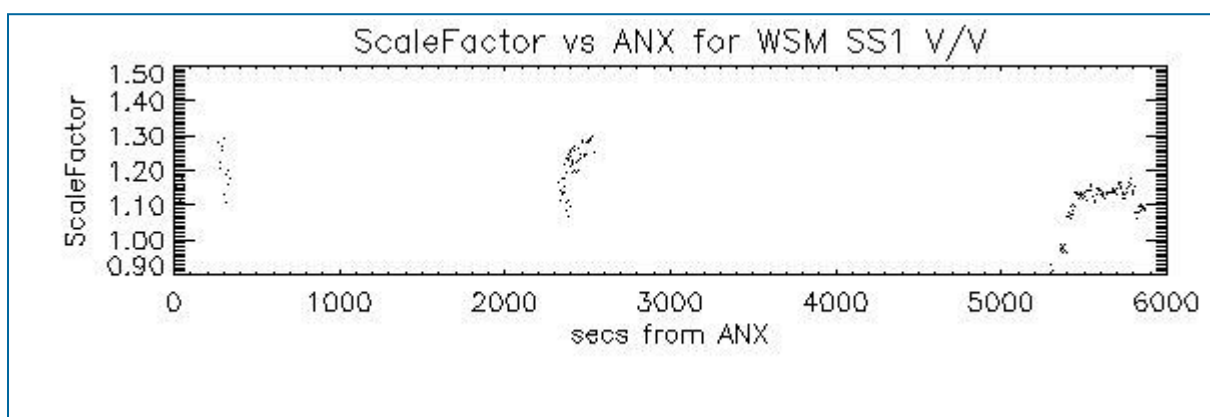




## 7 - RAW DATA ANALYSIS

### 7.1 - Analysis for WVS

[ [BACK TO MENU](#) ]

--	--	--



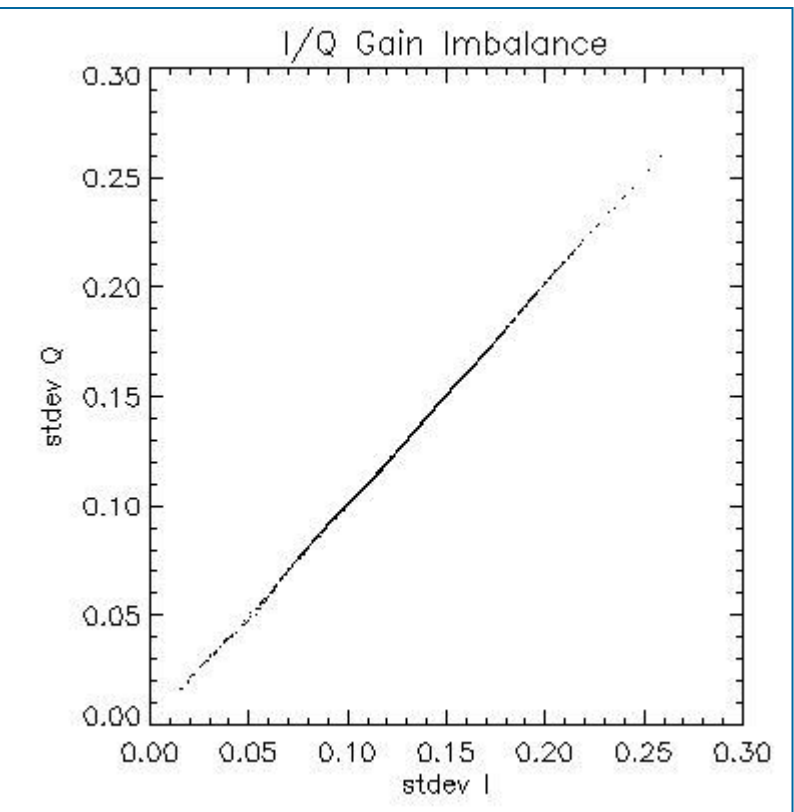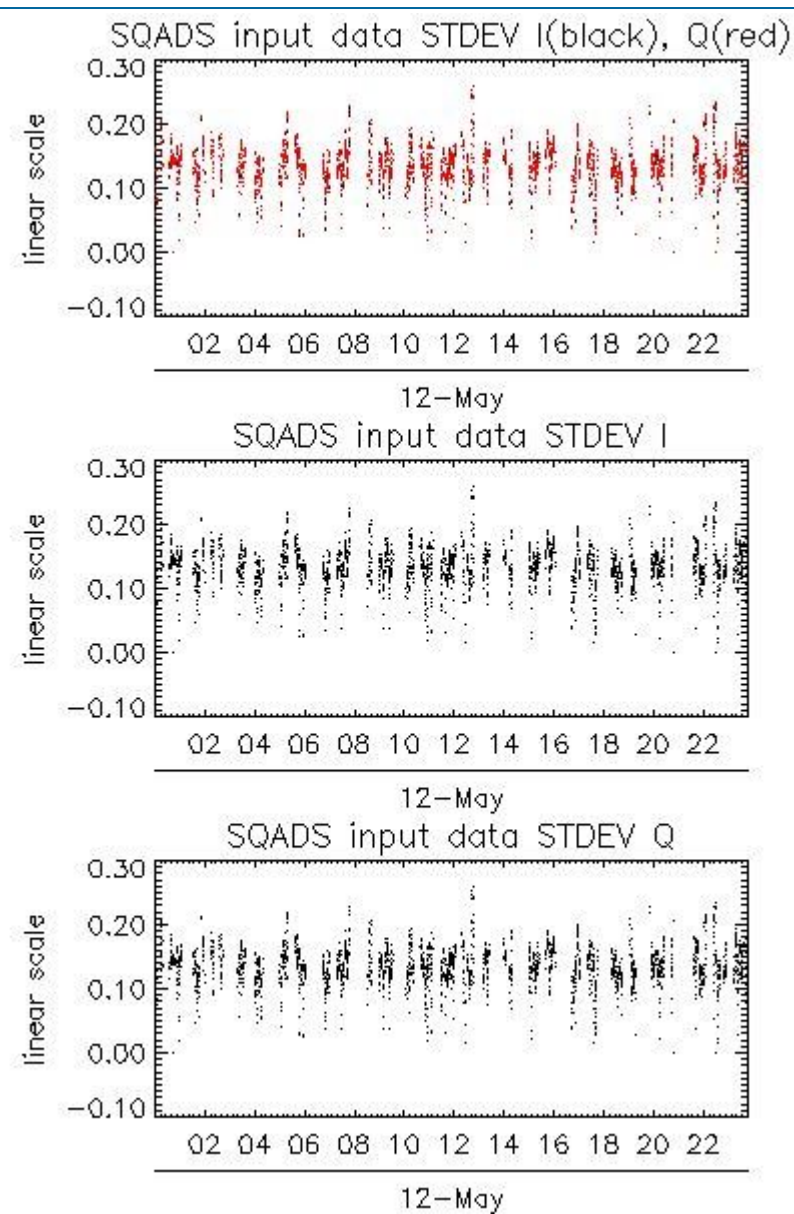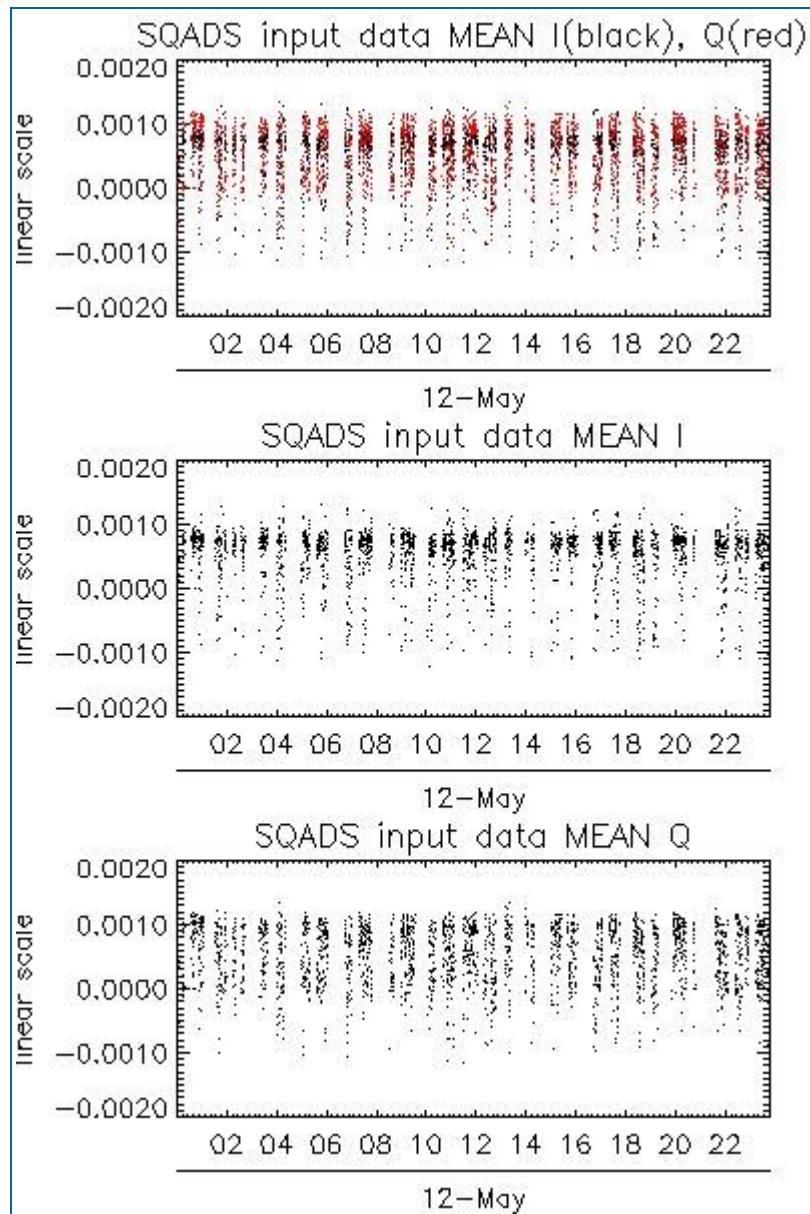


Channel	Statistics	DSS-B
MEAN I	mean	0.000525082
	stdev	1.80510e-07
MEAN Q	mean	0.000529223
	stdev	2.11694e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.134210
	stdev	0.00101885
STDEV Q	mean	0.134555
	stdev	0.00103282

## 7.2 - Analysis for IMM

[ [BACK TO MENU](#) ]

--	--	--

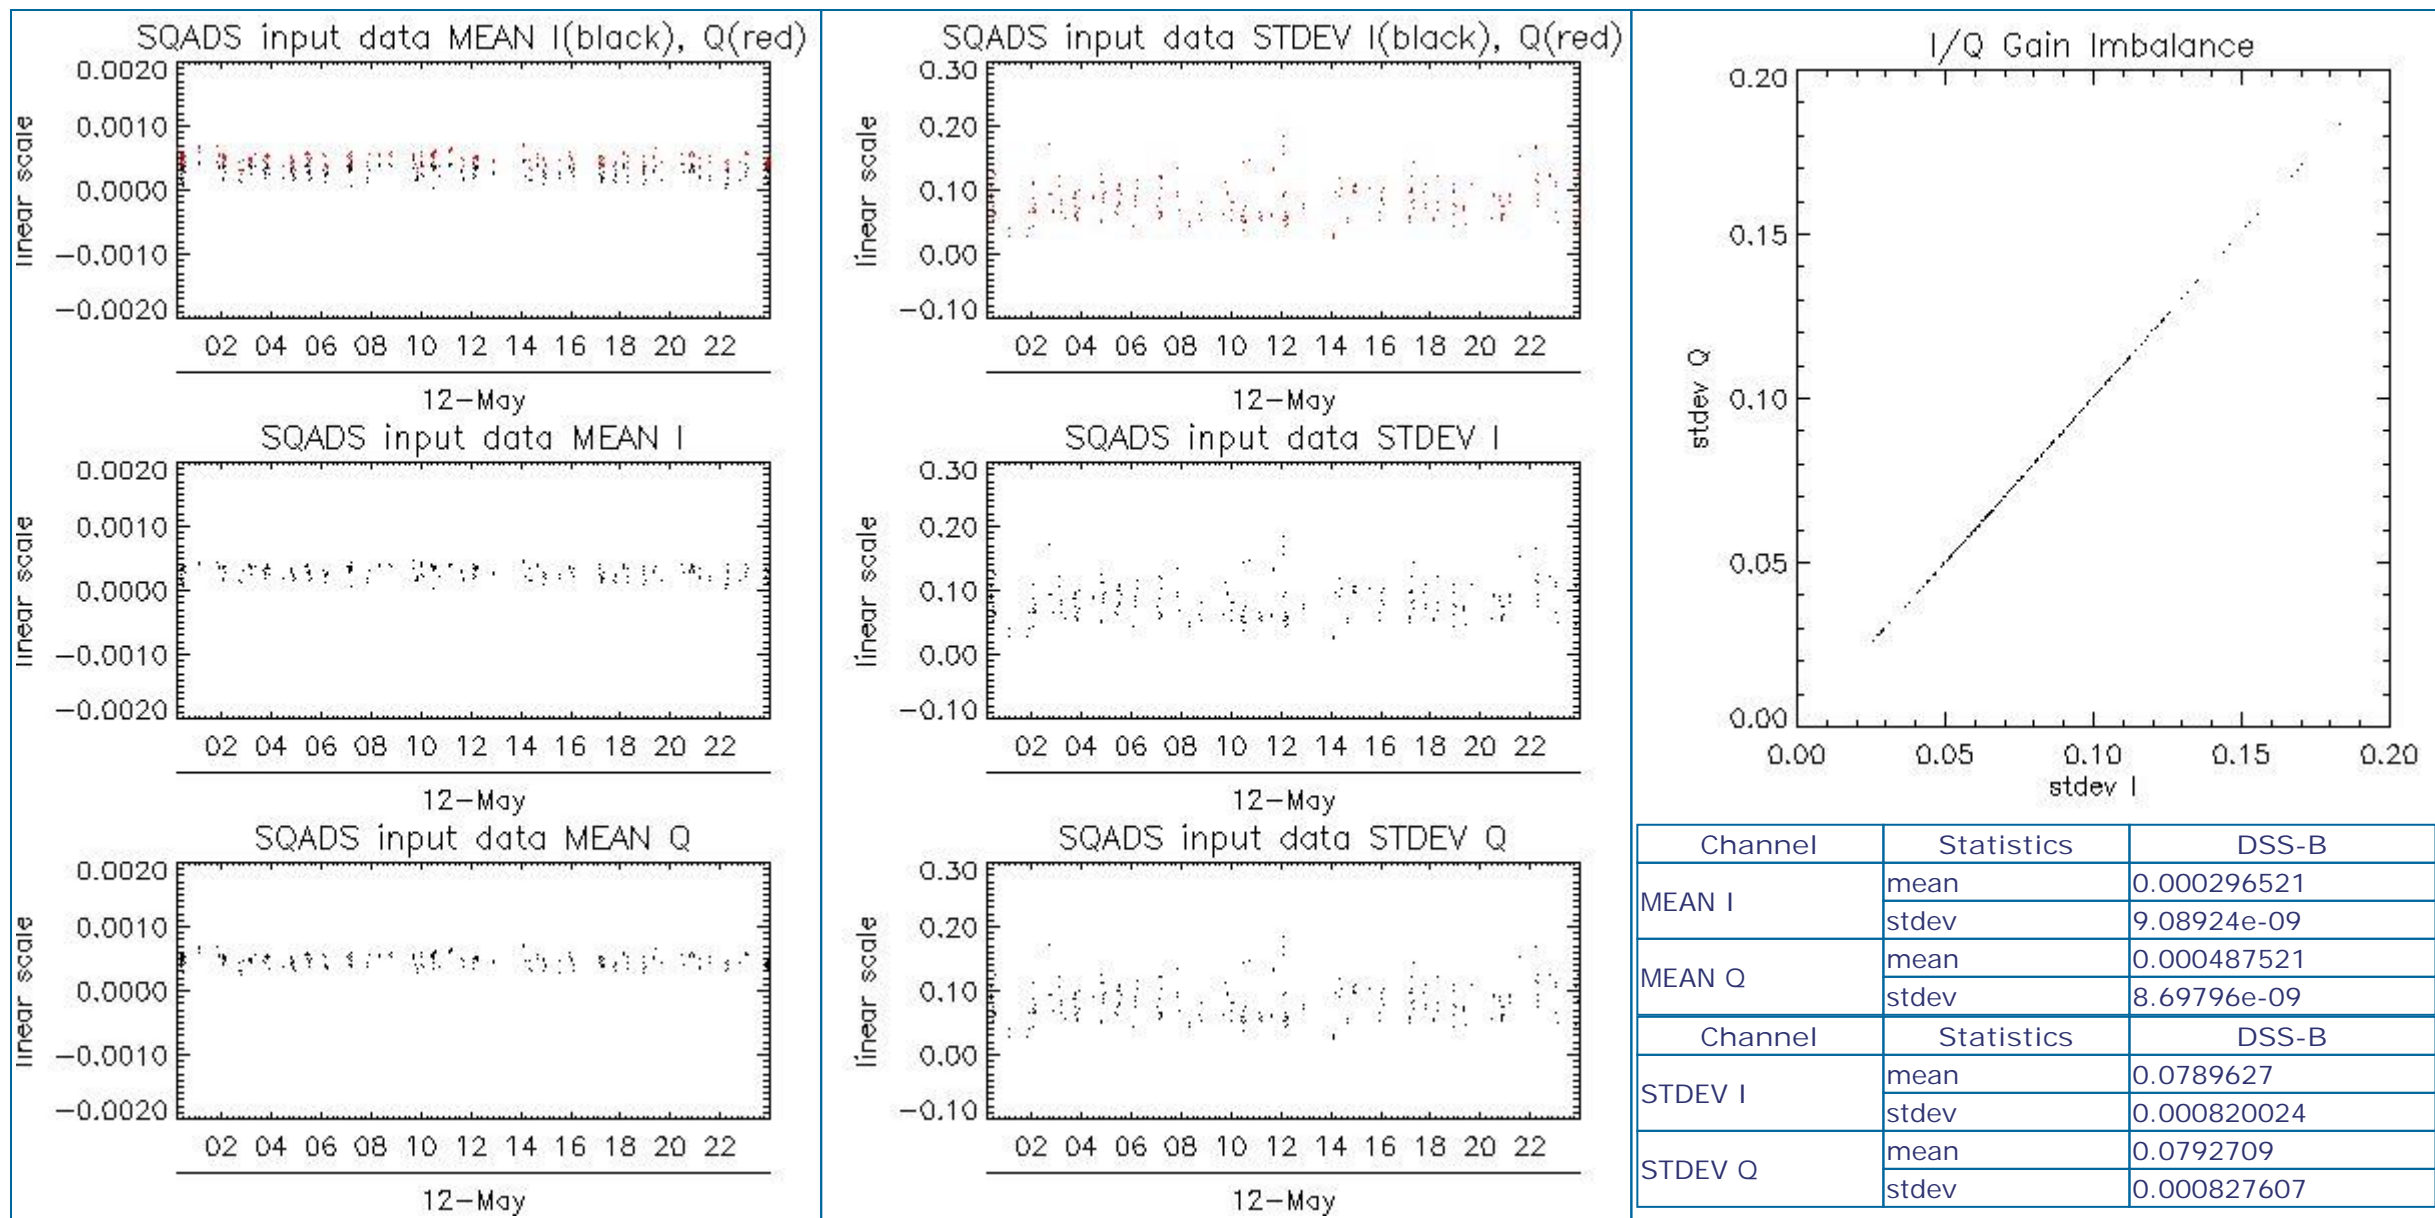



## 8 - TELEMETRY ANALYSIS

Processing Center	Product	Gaps	Missing lines
PDE	ASA_WSM_1PNPDE20080512_142113_00000672068_00297_32415_8587.N1	0	24
PDE	ASA_WSM_1PNPDE20080512_160304_00000852068_00298_32416_8623.N1	0	24

### 8.1 - Number of Missing lines


[ [BACK TO MENU](#) ]



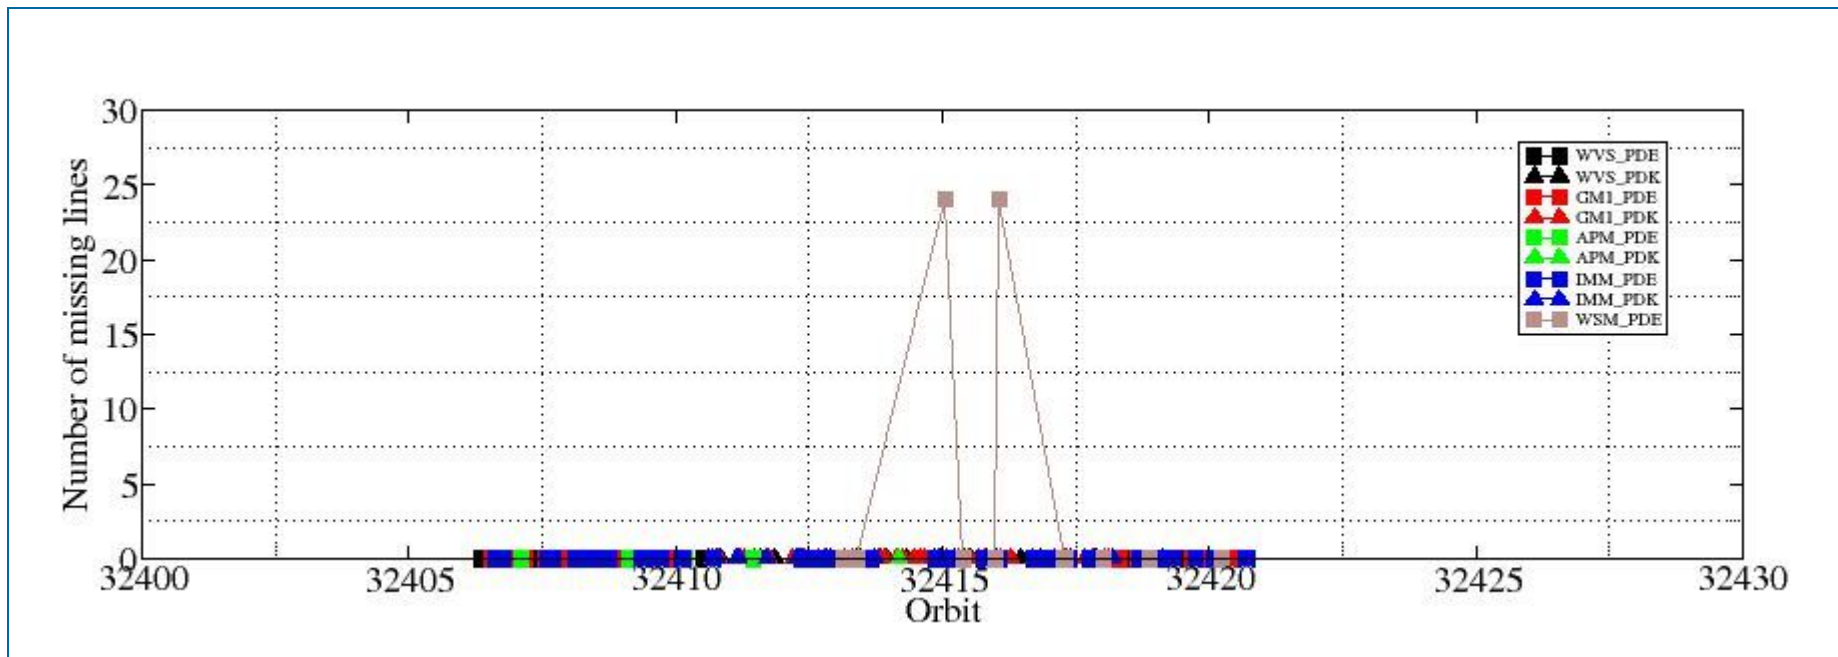

## 8.2 - Number of Gaps

[\[ BACK TO MENU \]](#)

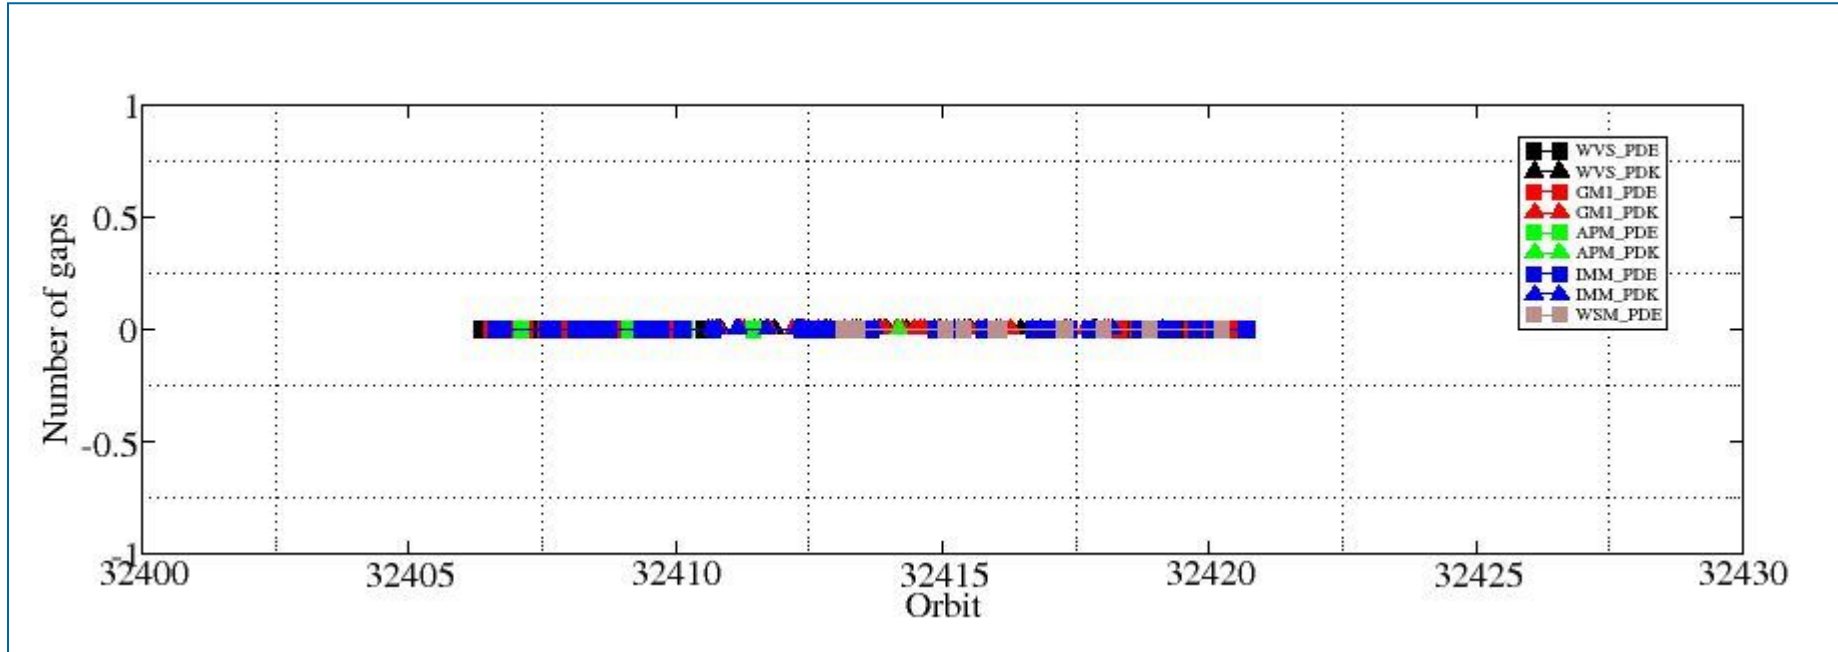

#####  
ASAR DAILY REPORT for 080512  
#####

MODE: DAILY  
ANALYSIS: ALL  
DATE: YESTERDAY

Analysis will be performed from 2008-05-12 00:00:00 to 2008-05-12 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/080512/

DATA SUMMARY

#####  
Summary will be performed from 2008-05-12 00:00:00 to 2008-05-12 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/080512/DATA\_SUMMARY

Creating directory ./RESULTS/DAILY/080512/DATA\_SUMMARY...  
Writing file ./RESULTS/DAILY/080512/DATA\_SUMMARY/Data\_summary.html...

\*\*\*\*\*  
Getting WVS products list from 2008-05-12 00:00:00 to 2008-05-12 23:59:59...  
Writing file ./RESULTS/DAILY/080512/DATA\_SUMMARY/List\_WVS\_products\_used.xls...  
Writing file ./RESULTS/DAILY/080512/DATA\_SUMMARY/List\_WVS\_products\_used.txt...

\*\*\*\*\*  
Getting GM1 products list from 2008-05-12 00:00:00 to 2008-05-12 23:59:59...  
Writing file ./RESULTS/DAILY/080512/DATA\_SUMMARY/List\_GM1\_products\_used.xls...  
Writing file ./RESULTS/DAILY/080512/DATA\_SUMMARY/List\_GM1\_products\_used.txt...

\*\*\*\*\*  
Getting APM products list from 2008-05-12 00:00:00 to 2008-05-12 23:59:59...  
Writing file ./RESULTS/DAILY/080512/DATA\_SUMMARY/List\_APM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/080512/DATA\_SUMMARY/List\_APM\_products\_used.txt...

\*\*\*\*\*  
Getting IMM products list from 2008-05-12 00:00:00 to 2008-05-12 23:59:59...  
Writing file ./RESULTS/DAILY/080512/DATA\_SUMMARY/List\_IMM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/080512/DATA\_SUMMARY/List\_IMM\_products\_used.txt...

\*\*\*\*\*  
Getting WSM products list from 2008-05-12 00:00:00 to 2008-05-12 23:59:59...  
Writing file ./RESULTS/DAILY/080512/DATA\_SUMMARY/List\_WSM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/080512/DATA\_SUMMARY/List\_WSM\_products\_used.txt...

\*\*\*\*\*  
Getting MS products list from 2008-05-12 00:00:00 to 2008-05-12 23:59:59...  
Writing file ./RESULTS/DAILY/080512/DATA\_SUMMARY/List\_MS\_products\_used.xls...  
Writing file ./RESULTS/DAILY/080512/DATA\_SUMMARY/List\_MS\_products\_used.txt...

DATA SUMMARY completed  
#####

AUXILIARY FILES ANALYSIS

#####  
Analysis will be performed from 2008-05-12 00:00:00 to 2008-05-12 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/080512/AUXILIARY

Creating directory ./RESULTS/DAILY/080512/AUXILIARY...

\*\*\*\*\*  
Looking for the IECF operational ADFs list...



Found list 20080512\_030001\_current\_3\_IECF\_ADFs.txt...  
Extracting ADFs...

ASA\_CON\_AXVIEC20071218\_084201\_20070204\_165113\_20081231\_000000  
ASA\_INS\_AXVIEC20071218\_083603\_20070307\_060000\_20081231\_000000  
ASA\_XCH\_AXVIEC20051219\_162547\_20020301\_000000\_20081231\_000000  
ASA\_XCA\_AXVIEC20071218\_082742\_20070204\_165113\_20081231\_000000

Writing file ./RESULTS/DAILY/080512/AUXILIARY/ASAR\_ADFs\_IECF\_List3.html...  
Writing file ./RESULTS/DAILY/080512/AUXILIARY/Auxiliary\_files\_summary.html...

\*\*\*\*\*  
Analysing WVS products...

Writing file ./RESULTS/DAILY/080512/AUXILIARY/Check\_ADFs\_WVS.xls...  
Writing file ./RESULTS/DAILY/080512/AUXILIARY/Check\_ADFs\_WVS.txt...

ASA_WVS_1PNPDE20080512_001330_000002702068_00288_32406_7700.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_003453_000003892068_00288_32406_7707.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_004038_000004192068_00288_32406_7864.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_005111_000007342068_00288_32406_7855.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_013245_000008852068_00289_32407_7877.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_015306_000003302068_00289_32407_7874.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_021529_000001052068_00289_32407_7867.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_021629_000003152068_00289_32407_7995.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_023539_000003892068_00290_32408_8021.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_031908_00000892068_00290_32408_8016.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_032217_000006292068_00290_32408_8013.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_033232_000002402068_00290_32408_8136.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_040031_000009442068_00290_32408_8145.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_041830_000000742068_00291_32409_8166.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_045959_000008392068_00291_32409_8184.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_051343_000003752068_00291_32409_8307.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_053641_000015442068_00291_32409_8341.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_064411_000006442068_00292_32410_8344.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_195224_000019792068_00300_32418_8710.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_204205_000002392068_00300_32418_8738.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_204520_000000452068_00300_32418_8861.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_213511_000018442068_00301_32419_8884.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_222241_000004192068_00301_32419_8879.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_222841_000006892068_00301_32419_9001.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_224819_000004502068_00302_32420_9006.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_231322_000013042068_00302_32420_9017.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20080512_234119_000003152068_00302_32420_9020.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_065441_000003452068_00292_32410_1144.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_071717_000019042068_00292_32410_1163.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_083228_000005252068_00293_32411_1234.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_085753_000020242068_00293_32411_1255.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_100435_000010192068_00294_32412_1397.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_103829_000003002068_00294_32412_1394.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_104512_000013642068_00294_32412_1428.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_112755_000003602068_00295_32413_1503.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_113605_000002092068_00295_32413_1506.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_114136_000012442068_00295_32413_1516.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_121905_000004052068_00295_32413_1519.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_123038_000010212068_00295_32413_1526.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_130946_000008692068_00296_32414_1666.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_135941_000002552068_00296_32414_1669.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_141302_000004342068_00296_32414_1687.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_145917_000003892068_00297_32415_1786.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_150904_000008692068_00297_32415_1793.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_154017_000009742068_00297_32415_1796.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_155839_000002092068_00298_32416_1801.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_164303_000012592068_00298_32416_1908.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_172044_000013942068_00298_32416_1922.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20080512_181844_000015592068_00299_32417_2040.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK



ASA\_WVS\_1PNPDK20080512\_190129\_000000602068\_00299\_32417\_2037.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_WVS\_1PNPDK20080512\_190501\_000007642068\_00299\_32417\_2052.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK

\*\*\*\*\*

Analysing GM1 products...

Writing file ./RESULTS/DAILY/080512/AUXILIARY/Check\_ADFs\_GM1.xls...

Writing file ./RESULTS/DAILY/080512/AUXILIARY/Check\_ADFs\_GM1.txt...

ASA\_GM1\_1PNPDE20080512\_000455\_000004102068\_00288\_32406\_7702.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_003234\_000001382068\_00288\_32406\_7704.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_004834\_000001572068\_00288\_32406\_7861.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_010808\_000014742068\_00289\_32407\_7953.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_014814\_000001142068\_00289\_32407\_7869.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_020859\_000003862068\_00289\_32407\_7871.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_022234\_000007852068\_00289\_32407\_7997.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_024636\_000004042068\_00290\_32408\_8083.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_025418\_000006702068\_00290\_32408\_8027.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_030636\_000002472068\_00290\_32408\_8023.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_031404\_000003022068\_00290\_32408\_8025.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_035344\_000001382068\_00290\_32408\_8133.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_035704\_000002052068\_00290\_32408\_8138.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_041705\_000000842068\_00291\_32409\_8140.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_042038\_000003502068\_00291\_32409\_8142.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_042737\_000010262068\_00291\_32409\_8251.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_044655\_000001992068\_00291\_32409\_8163.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_045550\_000002472068\_00291\_32409\_8186.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_052043\_000000842068\_00291\_32409\_8304.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_052444\_000000842068\_00291\_32409\_8302.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_053428\_000001322068\_00291\_32409\_8309.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_060322\_000001752068\_00292\_32410\_8313.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_061003\_000001382068\_00292\_32410\_8311.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_061332\_000018242068\_00292\_32410\_8411.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_193347\_000000662068\_00300\_32418\_8701.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_193851\_000005922068\_00300\_32418\_8703.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_195025\_000001142068\_00300\_32418\_8705.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_202606\_000001442068\_00300\_32418\_8707.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_203118\_000006462068\_00300\_32418\_8740.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_205645\_000007182068\_00300\_32418\_8863.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_212350\_000005372068\_00301\_32419\_8998.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_220642\_000004412068\_00301\_32419\_8881.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_222026\_000001322068\_00301\_32419\_8888.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_224053\_000003862068\_00302\_32420\_9003.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_230554\_000004472068\_00302\_32420\_9012.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_233556\_000002172068\_00302\_32420\_9010.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20080512\_233942\_000000962068\_00302\_32420\_9014.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_070119\_000001322068\_00292\_32410\_1141.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_070807\_000000842068\_00292\_32410\_1139.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_071417\_000001812068\_00292\_32410\_1152.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_075609\_000003982068\_00293\_32411\_1160.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_080210\_000005672068\_00293\_32411\_1227.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_082224\_000006042068\_00293\_32411\_1231.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_084311\_000001022068\_00293\_32411\_1229.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_084734\_000006162068\_00293\_32411\_1245.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_093235\_000005192068\_00294\_32412\_1252.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_094357\_000000782068\_00294\_32412\_1314.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_094434\_000001872068\_00294\_32412\_1377.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_095737\_000001082068\_00294\_32412\_1391.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_102231\_000000782068\_00294\_32412\_1389.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_103328\_000003022068\_00294\_32412\_1399.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_111313\_000005732068\_00295\_32413\_1425.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_112533\_000001382068\_00295\_32413\_1508.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_121621\_000001632068\_00295\_32413\_1513.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_122639\_000002352068\_00295\_32413\_1521.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_124825\_000002772068\_00296\_32414\_1523.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20080512\_125410\_000005312068\_00296\_32414\_1582.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK

```
ASA_GM1_1PNPDK20080512_130223_000002592068_00296_32414_1659.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_132507_000006462068_00296_32414_1661.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_133606_000003622068_00296_32414_1663.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_134342_000009242068_00296_32414_1673.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_140732_000002772068_00296_32414_1671.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_142412_000007732068_00297_32415_1752.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_144729_000003982068_00297_32415_1783.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_150633_000001502068_00297_32415_1788.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_152418_000004772068_00297_32415_1790.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_153428_000003442068_00297_32415_1798.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_160655_000004712068_00298_32416_1803.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_162443_000010992068_00298_32416_1991.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_170454_000002052068_00298_32416_1910.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_174806_000003982068_00299_32417_1919.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_180451_00000782068_00299_32417_2028.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_180941_000003802068_00299_32417_2030.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_184530_000004832068_00299_32417_2032.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_185901_000001442068_00299_32417_2034.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_192305_000003922068_00300_32418_2042.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20080512_193111_000002172068_00300_32418_2049.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

\*\*\*\*\*

Analysing APM products...

Writing file ./RESULTS/DAILY/080512/AUXILIARY/Check\_ADFs\_APM.xls...

Writing file ./RESULTS/DAILY/080512/AUXILIARY/Check\_ADFs\_APM.txt...

```
ASA_APM_1PNPDE20080512_010416_000001522068_00289_32407_7984.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20080512_030528_00000422068_00290_32408_7982.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20080512_032115_00000562068_00290_32408_8005.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20080512_042629_00000402068_00291_32409_8260.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20080512_044443_00000412068_00291_32409_8123.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20080512_044548_00000422068_00291_32409_8125.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20080512_061224_00000402068_00292_32410_8315.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20080512_082014_000001042068_00293_32411_8571.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20080512_082116_00000422068_00293_32411_8470.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDK20080512_125302_00000412068_00296_32414_1636.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

\*\*\*\*\*

Analysing IMM products...

Writing file ./RESULTS/DAILY/080512/AUXILIARY/Check\_ADFs\_IMM.xls...

Writing file ./RESULTS/DAILY/080512/AUXILIARY/Check\_ADFs\_IMM.txt...

```
ASA_IMM_1PNPDE20080512_001204_00000792068_00288_32406_7827.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_001946_000003012068_00288_32406_7832.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_001946_000003802068_00288_32406_7846.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_002548_00000182068_00288_32406_7811.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_002646_000003312068_00288_32406_7844.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_015009_00000502068_00289_32407_7955.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_015109_000001092068_00289_32407_7951.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_020046_000004742068_00289_32407_7986.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_024251_000002082068_00290_32408_8102.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_025323_00000372068_00290_32408_8092.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_031042_000001812068_00290_32408_8018.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_034106_000003212068_00290_32408_8117.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_034706_000003812068_00290_32408_8289.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_045014_000001312068_00291_32409_8249.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_045239_000001742068_00291_32409_8268.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_052207_000001402068_00291_32409_8270.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_052607_000004802068_00291_32409_8445.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_060618_00000662068_00292_32410_8409.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_060825_00000812068_00292_32410_8353.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_070329_000002612068_00292_32410_8453.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

ASA_IMM_1PNPDE20080512_095214_000000372068_00294_32412_8481.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_095926_000002402068_00294_32412_8494.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_095926_000003012068_00294_32412_8527.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_102350_000004412068_00294_32412_8515.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_103045_000001452068_00294_32412_8543.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_104414_000000512068_00294_32412_8537.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_114015_000000742068_00295_32413_8529.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_120346_000002602068_00295_32413_8563.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_140431_000001412068_00296_32414_8611.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_141219_000000362068_00296_32414_8585.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_142234_000000802068_00297_32415_8609.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_145404_000000512068_00297_32415_8593.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_153218_000001132068_00297_32415_8583.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_160446_000001132068_00298_32416_8621.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_170818_000002602068_00298_32416_8691.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_171120_000000782068_00298_32416_8673.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_171318_000003752068_00298_32416_8805.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_171920_000000132068_00298_32416_8643.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_174433_000001942068_00299_32417_8699.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_181602_000001552068_00299_32417_9784.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_185335_000000622068_00299_32417_8679.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_185335_000003092068_00299_32417_8807.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_185637_000000592068_00299_32417_8685.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_202829_000001512068_00300_32418_8830.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_211134_000000502068_00301_32419_8957.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_213342_000000812068_00301_32419_8965.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_221402_000003682068_00301_32419_8983.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_224722_000000512068_00302_32420_8963.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_234813_000000802068_00302_32420_9125.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_235013_000000802068_00302_32420_9008.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20080512_235213_000004892068_00302_32420_9166.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080512_070930_000002712068_00292_32410_1193.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080512_074940_000001632068_00293_32411_1207.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080512_075239_000000392068_00293_32411_1195.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080512_084456_000001402068_00293_32411_1355.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080512_094112_000000812068_00294_32412_1312.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080512_094304_000000362068_00294_32412_1241.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080512_094739_000000372068_00294_32412_1346.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080512_095131_000000822068_00294_32412_1370.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080512_120846_000004382068_00295_32413_1653.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080512_143943_000000662068_00297_32415_1758.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080512_193743_000000512068_00300_32418_2121.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20080512_211134_000000672068_00301_32419_2156.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

\*\*\*\*\*

Analysing WSM products...

Writing file ./RESULTS/DAILY/080512/AUXILIARY/Check\_ADFs\_WSM.xls...

Writing file ./RESULTS/DAILY/080512/AUXILIARY/Check\_ADFs\_WSM.txt...

ASA_WSM_1PNPDE20080512_110848_000002442068_00295_32413_8569.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080512_110848_000002442068_00295_32413_8577.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080512_113442_000000852068_00295_32413_8541.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080512_142113_000000672068_00297_32415_8587.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080512_145532_000002252068_00297_32415_8625.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080512_155715_000000672068_00297_32415_8627.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080512_155715_000000862068_00297_32415_8803.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080512_160304_000000852068_00298_32416_8623.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080512_180617_000000672068_00299_32417_8693.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080512_180617_000001832068_00299_32417_8828.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080512_180825_000000552068_00299_32417_8697.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080512_191919_000002142068_00300_32418_8865.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080512_204658_000005742068_00300_32418_8967.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080512_204658_000005742068_00300_32418_9123.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080512_230127_000002442068_00302_32420_9378.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20080512_230234_000001762068_00302_32420_9168.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK



AUXILIARY FILES ANALYSIS completed

#####

MODULE STEPPING ANALYSIS

#####

Analysis will be performed from 2008-05-12 00:00:00 to 2008-05-12 23:59:59

Results will be exported to the directory: ./RESULTS/DAILY/080512/MODULE\_STEPPING

Creating directory ./RESULTS/DAILY/080512/MODULE\_STEPPING...

Creating directory ./RESULTS/DAILY/080512/MODULE\_STEPPING/FIRST\_REFERENCE...

Creating directory ./RESULTS/DAILY/080512/MODULE\_STEPPING/SECOND\_REFERENCE...

Creating directory ./RESULTS/DAILY/080512/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE...

Deleting old files...

\*\*\*\*\*  
\*\*\*\*\*

Creating images comparing with second reference...

Exporting results to the directory ../../RESULTS/DAILY/080512/MODULE\_STEPPING/SECOND\_REFERENCE...

Polarization: H

Reference product: ASA\_MS\_\_0PNPDK20050922\_062651\_00000152041\_00034\_18625\_0041.N1

Test product: ASA\_MS\_\_0PNPDE20080512\_015923\_00000162068\_00289\_32407\_0286.N1

H

H

../../RESULTS/DAILY/080512/MODULE\_STEPPING/SECOND\_REFERENCE/TGH\_20080512\_015923-20050922\_062651.png

../../RESULTS/DAILY/080512/MODULE\_STEPPING/SECOND\_REFERENCE/TPH\_20080512\_015923-20050922\_062651.png

../../RESULTS/DAILY/080512/MODULE\_STEPPING/SECOND\_REFERENCE/RGH\_20080512\_015923-20050922\_062651.png

../../RESULTS/DAILY/080512/MODULE\_STEPPING/SECOND\_REFERENCE/RPH\_20080512\_015923-20050922\_062651.png

Polarization: V

Reference product: ASA\_MS\_\_0PNPDK20050923\_055514\_00000152041\_00048\_18639\_0042.N1

Test product: ASA\_MS\_\_0PNPDK20080512\_084147\_00000162068\_00293\_32411\_0542.N1

V

V

../../RESULTS/DAILY/080512/MODULE\_STEPPING/SECOND\_REFERENCE/TGV\_20080512\_084147-20050923\_055514.png

../../RESULTS/DAILY/080512/MODULE\_STEPPING/SECOND\_REFERENCE/TPV\_20080512\_084147-20050923\_055514.png

../../RESULTS/DAILY/080512/MODULE\_STEPPING/SECOND\_REFERENCE/RGV\_20080512\_084147-20050923\_055514.png

../../RESULTS/DAILY/080512/MODULE\_STEPPING/SECOND\_REFERENCE/RPV\_20080512\_084147-20050923\_055514.png

\*\*\*\*\*  
\*\*\*\*\*

Creating images comparing with previous product reference...

Exporting results to the directory ../../RESULTS/DAILY/080512/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE...

Polarization: H

Reference product: ASA\_MS\_\_0PNPDE20080510\_030237\_00000162068\_00261\_32379\_0284.N1

Test product: ASA\_MS\_\_0PNPDE20080512\_015923\_00000162068\_00289\_32407\_0286.N1

H

H

../../RESULTS/DAILY/080512/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TGH\_20080512\_015923-20080510\_030237.png

../../RESULTS/DAILY/080512/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TPH\_20080512\_015923-20080510\_030237.png

../../RESULTS/DAILY/080512/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RGH\_20080512\_015923-20080510\_030237.png

../../RESULTS/DAILY/080512/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RPH\_20080512\_015923-20080510\_030237.png

Polarization: V

Reference product: ASA\_MS\_\_0PNPDE20080511\_023100\_00000162068\_00275\_32393\_0285.N1

Test product: ASA\_MS\_\_0PNPDK20080512\_084147\_00000162068\_00293\_32411\_0542.N1

V

V

../../RESULTS/DAILY/080512/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TGV\_20080512\_084147-20080511\_023100.png

../../RESULTS/DAILY/080512/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TPV\_20080512\_084147-20080511\_023100.png

../../RESULTS/DAILY/080512/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RGV\_20080512\_084147-20080511\_023100.png  
../../RESULTS/DAILY/080512/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RPV\_20080512\_084147-20080511\_023100.png

MODULE\_STEPPING ANALYSIS completed

#####

CALIBRATION PULSES ANALYSIS

#####

Creating directory ./RESULTS/DAILY/080512/CALIBRATION\_PULSES...

\*\*\*\*\*  
\*\*\*\*\*

ALL ROWS Analysis will be performed from 2008-05-12 00:00:00 to 2008-05-12 23:59:59

Analysing products WVS IS2 V/V

Writing image ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Calibration\_pulses\_all\_rows\_WVS\_IS2\_VV.png...

Analysing products GM1 SS3 H/H

Writing image ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Calibration\_pulses\_all\_rows\_GM1\_SS3\_HH.png...

\*\*\*\*\*  
\*\*\*\*\*

TEMPORAL EVOLUTION Analysis will be performed from 2008-05-12 00:00:00 to 2008-05-12 23:59:59

Analysing products WVS IS2 V/V

Getting calibration pulses data for WVS IS2 V/V from 2008-05-12 00:00:00 to 2008-05-12 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/080512/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2008-05-12\_1.dat...

Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_1.png...

Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2008-05-12 00:00:00 to 2008-05-12 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/080512/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2008-05-12\_2.dat...

Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_2.png...

Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2008-05-12 00:00:00 to 2008-05-12 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/080512/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2008-05-12\_3.dat...

Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_3.png...

Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2008-05-12 00:00:00 to 2008-05-12 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/080512/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2008-05-12\_4.dat...

Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_4.png...

Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_4.png...

Analysing products GM1 SS3 H/H

Getting calibration pulses data for GM1 SS3 H/H from 2008-05-12 00:00:00 to 2008-05-12 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/080512/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2008-05-12\_1.dat...

Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_1.png...

Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_1.png...

Getting calibration pulses data for GM1 SS3 H/H from 2008-05-12 00:00:00 to 2008-05-12 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/080512/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2008-05-12\_2.dat...

Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_2.png...

Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2008-05-12 00:00:00 to 2008-05-12 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/080512/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2008-05-12\_3.dat...

Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_3.png...  
Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2008-05-12 00:00:00 to 2008-05-12 23:59:59. Rows: 4/8/12/16/20/24/28/32  
Writing file ./RESULTS/DAILY/080512/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2008-05-12\_4.dat...  
Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_4.png...  
Writing ../../RESULTS/DAILY/080512//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_4.png...

CALIBRATION PULSES ANALYSIS completed  
#####

DOPPLER ANALYSIS  
#####  
Creating directory ./RESULTS/DAILY/080512/DOPPLER...

\*\*\*\*\*  
\*\*\*\*\*  
DOPPLER ANX Analysis will be performed from 2008-05-12 00:00:00 to 2008-05-12 23:59:59

Analysing products WVS IS2 V/V  
Getting doppler data for WVS IS2 V/V from 2008-05-12 00:00:00 to 2008-05-12 23:59:59...  
Writing file ./RESULTS/DAILY/080512/DOPPLER/Doppler\_data\_WVS\_IS2\_VV\_2008-05-12.dat...  
Running IDL program...  
Writing file ../../RESULTS/DAILY/080512/DOPPLER/DOPPLER\_ANX\_WVS\_IS2\_VV.png...

Analysing products GM1 SS1 H/H  
Getting doppler data for GM1 SS1 H/H from 2008-05-12 00:00:00 to 2008-05-12 23:59:59...  
Writing file ./RESULTS/DAILY/080512/DOPPLER/Doppler\_data\_GM1\_SS1\_HH\_2008-05-12.dat...  
Running IDL program...  
Writing file ../../RESULTS/DAILY/080512/DOPPLER/DOPPLER\_ANX\_GM1\_SS1\_HH.png...

\*\*\*\*\*  
\*\*\*\*\*  
DOPPLER JUMPS Analysis will be performed on WSM products from 2008-05-12 00:00:00 to 2008-05-12 23:59:59

Analysing by default products WSM  
Getting doppler jumps data for WSM from 2008-05-12 00:00:00 to 2008-05-12 23:59:59...  
Writing file ./RESULTS/DAILY/080512/DOPPLER/Doppler\_Jumps\_data\_WSM\_2008-05-12.dat...  
Running IDL program...  
Writing file ../../RESULTS/DAILY/080512/DOPPLER/DOPPLER\_JUMPS\_ANX\_WSM.png...  
Writing file ../../RESULTS/DAILY/080512/DOPPLER/DOPPLER\_JUMPS\_Date\_WSM.png...

\*\*\*\*\*  
\*\*\*\*\*  
DOPPLER MAP Analysis will be performed from 2008-05-12 00:00:00 to 2008-05-12 23:59:59

Analysing products WVS IS2 V/V  
Loading predicted doppler values....  
Phase: descending  
Found data...  
Computing mean error doppler estimated-predicted...  
Mean error = -30.251383 Hz  
Writing file ../../RESULTS/DAILY/080512//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_WVS\_IS2\_VV\_desc.jpg...  
Writing file ../../RESULTS/DAILY/080512//DOPPLER/DOPPLER\_Absolute\_WVS\_IS2\_VV\_desc.jpg...

\*\*\*\*\*  
Loading predicted doppler values....  
Phase: ascending  
Found data...



Computing mean error doppler estimated-predicted...  
 Mean error = -23.137652 Hz  
 Writing file ../../RESULTS/DAILY/080512//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_WVS\_IS2\_VV\_asc.jpg...  
 Writing file ../../RESULTS/DAILY/080512//DOPPLER/DOPPLER\_Absolute\_WVS\_IS2\_VV\_asc.jpg...

\*\*\*\*\*

Analysing products GM1 SS1 H/H  
 Loading predicted doppler values....  
 Phase: descending  
 Found data...  
 Computing mean error doppler estimated-predicted...  
 Mean error = -21.623270 Hz  
 Writing file ../../RESULTS/DAILY/080512//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_GM1\_SS1\_HH\_desc.jpg...  
 Writing file ../../RESULTS/DAILY/080512//DOPPLER/DOPPLER\_Absolute\_GM1\_SS1\_HH\_desc.jpg...

\*\*\*\*\*

Loading predicted doppler values....  
 Phase: ascending  
 Found data...  
 Computing mean error doppler estimated-predicted...  
 Mean error = -26.828515 Hz  
 Writing file ../../RESULTS/DAILY/080512//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_GM1\_SS1\_HH\_asc.jpg...  
 Writing file ../../RESULTS/DAILY/080512//DOPPLER/DOPPLER\_Absolute\_GM1\_SS1\_HH\_asc.jpg...

\*\*\*\*\*

DOPPLER ANALYSIS completed  
 #####

CHIRP ANALYSIS  
 #####  
 Creating directory ./RESULTS/DAILY/080512/CHIRP...

\*\*\*\*\*  
 \*\*\*\*\*  
 CHIRP Analysis will be performed from 2008-05-12 00:00:00 to 2008-05-12 23:59:59

Analysing products WSM SS1 H/H  
 \*\*\*\*\*  
 Getting ScaleFactor data for WSM SS1 H/H from 2008-05-12 00:00:00 to 2008-05-12 23:59:59...  
 Writing file ./RESULTS/DAILY/080512/CHIRP/ScaleFactor\_data\_WSM\_SS1\_HH\_2008-05-12.dat...  
 Running IDL program...  
 Writing file ../../RESULTS/DAILY/080512/CHIRP/ScaleFactor\_ANX\_WSM\_SS1\_HH.png...  
 Writing file ../../RESULTS/DAILY/080512/CHIRP/ScaleFactor\_DATE\_WSM\_SS1\_HH.png...

Analysing products WSM SS1 V/V  
 \*\*\*\*\*  
 Getting ScaleFactor data for WSM SS1 V/V from 2008-05-12 00:00:00 to 2008-05-12 23:59:59...  
 Writing file ./RESULTS/DAILY/080512/CHIRP/ScaleFactor\_data\_WSM\_SS1\_VV\_2008-05-12.dat...  
 Running IDL program...  
 Writing file ../../RESULTS/DAILY/080512/CHIRP/ScaleFactor\_ANX\_WSM\_SS1\_VV.png...  
 Writing file ../../RESULTS/DAILY/080512/CHIRP/ScaleFactor\_DATE\_WSM\_SS1\_VV.png...

CHIRP ANALYSIS completed  
 #####

RAW DATA ANALYSIS

#####  
Analysis will be performed from 2008-05-12 00:00:00 to 2008-05-12 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/080512/RAW\_DATA

Creating directory ./RESULTS/DAILY/080512/RAW\_DATA...

\*\*\*\*\*  
Getting raw data for WVS from 2008-05-12 00:00:00 to 2008-05-12 23:59:59...  
Writing file ./RESULTS/DAILY/080512/RAW\_DATA/Raw\_data\_WVS\_2008-05-12.dat...  
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/080512/RAW\_DATA/Raw\_data\_WVS\_input\_mean.png...  
Creating image ../../RESULTS/DAILY/080512/RAW\_DATA/Raw\_data\_WVS\_input\_stddev.png...  
Creating image ../../RESULTS/DAILY/080512/RAW\_DATA/Raw\_data\_WVS\_gain\_imbalance.png...

\*\*\*\*\*  
Getting raw data for IMM from 2008-05-12 00:00:00 to 2008-05-12 23:59:59...  
Writing file ./RESULTS/DAILY/080512/RAW\_DATA/Raw\_data\_IMM\_2008-05-12.dat...  
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/080512/RAW\_DATA/Raw\_data\_IMM\_input\_mean.png...  
Creating image ../../RESULTS/DAILY/080512/RAW\_DATA/Raw\_data\_IMM\_input\_stddev.png...  
Creating image ../../RESULTS/DAILY/080512/RAW\_DATA/Raw\_data\_IMM\_gain\_imbalance.png...

RAW DATA ANALYSIS completed  
#####

TELEMETRY ANALYSIS

#####  
Analysis will be performed from 2008-05-12 00:00:00 to 2008-05-12 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/080512/TELEMETRY

Creating directory ./RESULTS/DAILY/080512/TELEMETRY...

Looking for gaps and missing lines in WVS products...  
\*\*\*\*\*  
Checking 28 products from PDE...  
Checking 24 products from PDK...

Looking for gaps and missing lines in GM1 products...  
\*\*\*\*\*  
Checking 37 products from PDE...  
Checking 40 products from PDK...

Looking for gaps and missing lines in APM products...  
\*\*\*\*\*  
Checking 9 products from PDE...  
Checking 1 products from PDK...

Looking for gaps and missing lines in IMM products...  
\*\*\*\*\*  
Checking 51 products from PDE...  
Checking 12 products from PDK...

Looking for gaps and missing lines in WSM products...  
\*\*\*\*\*  
Checking 16 products from PDE...  
Found product...ASA\_WSM\_1PNPDE20080512\_142113\_00000672068\_00297\_32415\_8587.N1 / 0 gaps / 24 missing lines  
Found product...ASA\_WSM\_1PNPDE20080512\_160304\_00000852068\_00298\_32416\_8623.N1 / 0 gaps / 24 missing lines  
No products from PDK...

Creating graph of missing lines and gaps...  
\*\*\*\*\*  
Creating image: ./RESULTS/DAILY/080512/TELEMETRY/TELEMETRY\_Missing\_lines.png...

Creating image: ./RESULTS/DAILY/080512/TELEMETRY/TELEMETRY\_Gaps.png...

TELEMETRY ANALYSIS completed

#####

BROWSE PRODUCTS ANALYSIS

#####

Analysis will be performed on 2008-05-12

\*\*\*\*\*

Scanning directory /nas3/ENVISAT/ASAR//ASA\_GM\_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA\_GM\_BP/JPG/20080512/

Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20080512\_193347\_000000662068\_00300\_32418\_8702.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20080512\_193851\_000005922068\_00300\_32418\_8704.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20080512\_195025\_000001142068\_00300\_32418\_8706.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20080512\_202606\_000001442068\_00300\_32418\_8708.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20080512\_203118\_000006462068\_00300\_32418\_8741.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20080512\_205645\_000007182068\_00300\_32418\_8864.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20080512\_212350\_000005372068\_00301\_32419\_8999.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20080512\_220642\_000004412068\_00301\_32419\_8882.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20080512\_222026\_000001322068\_00301\_32419\_8889.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20080512\_224053\_000003862068\_00302\_32420\_9004.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20080512\_230554\_000004472068\_00302\_32420\_9013.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20080512\_233556\_000002172068\_00302\_32420\_9011.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_GM\_BP/ASA\_GM\_BPZPDE20080512\_233942\_000000962068\_00302\_32420\_9015.N1 ...

ANALYSIS COMPLETED: 13 GM browse products to see...

\*\*\*\*\*

\*\*\*\*\*

Scanning directory /nas3/ENVISAT/ASAR//ASA\_AP\_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA\_AP\_BP/JPG/20080512/

Stripping browse product /nas3/ENVISAT/ASAR//ASA\_AP\_BP/ASA\_AP\_BPZPDE20080512\_082014\_000001042068\_00293\_32411\_8572.N1 ...

ANALYSIS COMPLETED: 1 AP browse products to see...

\*\*\*\*\*

\*\*\*\*\*

Scanning directory /nas3/ENVISAT/ASAR//ASA\_IM\_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA\_IM\_BP/JPG/20080512/

Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_095214\_000000372068\_00294\_32412\_8482.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_095926\_000002402068\_00294\_32412\_8495.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_095926\_000003012068\_00294\_32412\_8528.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_102350\_000004412068\_00294\_32412\_8516.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_103045\_000001452068\_00294\_32412\_8544.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_104414\_000000512068\_00294\_32412\_8538.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_114015\_000000742068\_00295\_32413\_8530.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_120346\_000002602068\_00295\_32413\_8564.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_140431\_000001412068\_00296\_32414\_8612.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_141219\_000000362068\_00296\_32414\_8586.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_142234\_000000802068\_00297\_32415\_8610.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_145404\_000000512068\_00297\_32415\_8594.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_153218\_000001132068\_00297\_32415\_8584.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_160446\_000001132068\_00298\_32416\_8622.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_170818\_000002602068\_00298\_32416\_8692.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_171120\_000000782068\_00298\_32416\_8674.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_171318\_000003752068\_00298\_32416\_8806.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_171920\_000000132068\_00298\_32416\_8644.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_174433\_000001942068\_00299\_32417\_8700.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_185335\_000000622068\_00299\_32417\_8680.N1 ...  
Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_185335\_000003092068\_00299\_32417\_8808.N1 ...



Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_185637\_000000592068\_00299\_32417\_8686.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_202829\_000001512068\_00300\_32418\_8831.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_211134\_000000502068\_00301\_32419\_8958.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_213342\_000000812068\_00301\_32419\_8966.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_221402\_000003682068\_00301\_32419\_8984.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_224722\_000000512068\_00302\_32420\_8964.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_234813\_000000802068\_00302\_32420\_9126.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_235013\_000000802068\_00302\_32420\_9009.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDE20080512\_235213\_000004892068\_00302\_32420\_9167.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_IM\_BP/ASA\_IM\_BPZPDK20080512\_211134\_000000672068\_00301\_32419\_2157.N1 ...

ANALYSIS COMPLETED: 31 IM browse products to see...

\*\*\*\*\*

\*\*\*\*\*

Scanning directory /nas3/ENVISAT/ASAR//ASA\_WS\_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA\_WS\_BP/JPG/20080512/

Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_110848\_000002442068\_00295\_32413\_8578.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_110955\_000001762068\_00295\_32413\_8570.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_113442\_000000852068\_00295\_32413\_8542.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_142113\_000000672068\_00297\_32415\_8588.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_145532\_000002252068\_00297\_32415\_8626.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_155715\_000000672068\_00297\_32415\_8628.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_155715\_000000862068\_00297\_32415\_8804.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_160304\_000000852068\_00298\_32416\_8624.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_180617\_000000672068\_00299\_32417\_8694.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_180617\_000001832068\_00299\_32417\_8829.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_180825\_000000552068\_00299\_32417\_8698.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_191919\_000002142068\_00300\_32418\_8866.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_204658\_000005742068\_00300\_32418\_8968.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_204658\_000005742068\_00300\_32418\_9124.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_230127\_000002442068\_00302\_32420\_9379.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDE20080512\_230234\_000001762068\_00302\_32420\_9169.N1 ...  
 Stripping browse product /nas3/ENVISAT/ASAR//ASA\_WS\_BP/ASA\_WS\_BPZPDK20080512\_193502\_000001462068\_00300\_32418\_2130.N1 ...

ANALYSIS COMPLETED: 17 WS browse products to see...

\*\*\*\*\*

BROWSE PRODUCTS ANALYSIS completed

#####

HTML REPORT generation

#####

Building file ./RESULTS/DAILY/080512/asarReport.html...

Building DATA SUMMARY section...

Building AUXILIARY FILES ANALYSIS section...

Building MODULE STEPPING ANALYSIS section...

Building CALIBRATION PULSES ANALYSIS section...

Building DOPPLER ANALYSIS section...

Building CHIRP ANALYSIS section...

Building RAW DATA ANALYSIS section...

Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed

#####



# ASAR Daily Report





Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20080512_010416_000001522068_00289_32407_7984.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20080512_030528_000000422068_00290_32408_7982.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20080512_032115_000000562068_00290_32408_8005.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20080512_042629_000000402068_00291_32409_8260.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20080512_044443_000000412068_00291_32409_8123.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20080512_044548_000000422068_00291_32409_8125.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20080512_061224_000000402068_00292_32410_8315.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20080512_082014_000001042068_00293_32411_8571.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20080512_082116_000000422068_00293_32411_8470.N1	OK	OK	OK	OK
ASA_APM_1PNPDK20080512_125302_000000412068_00296_32414_1636.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20080512_000455_000004102068_00288_32406_7702.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_003234_000001382068_00288_32406_7704.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_004834_000001572068_00288_32406_7861.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_010808_000014742068_00289_32407_7953.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_014814_000001142068_00289_32407_7869.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_020859_000003862068_00289_32407_7871.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_022234_000007852068_00289_32407_7997.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_024636_000004042068_00290_32408_8083.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_025418_000006702068_00290_32408_8027.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_030636_000002472068_00290_32408_8023.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_031404_000003022068_00290_32408_8025.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_035344_000001382068_00290_32408_8133.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_035704_000002052068_00290_32408_8138.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_041705_000000842068_00291_32409_8140.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_042038_000003502068_00291_32409_8142.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_042737_000010262068_00291_32409_8251.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_044655_000001992068_00291_32409_8163.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_045550_000002472068_00291_32409_8186.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_052043_000000842068_00291_32409_8304.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_052444_000000842068_00291_32409_8302.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_053428_000001322068_00291_32409_8309.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_060322_000001752068_00292_32410_8313.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_061003_000001382068_00292_32410_8311.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_061332_000018242068_00292_32410_8411.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_193347_000000662068_00300_32418_8701.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_193851_000005922068_00300_32418_8703.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_195025_000001142068_00300_32418_8705.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_202606_000001442068_00300_32418_8707.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_203118_000006462068_00300_32418_8740.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_205645_000007182068_00300_32418_8863.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_212350_000005372068_00301_32419_8998.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_220642_000004412068_00301_32419_8881.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_222026_000001322068_00301_32419_8888.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_224053_000003862068_00302_32420_9003.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_230554_000004472068_00302_32420_9012.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_233556_000002172068_00302_32420_9010.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20080512_233942_000000962068_00302_32420_9014.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_070119_000001322068_00292_32410_1141.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_070807_000000842068_00292_32410_1139.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_071417_000001812068_00292_32410_1152.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_075609_000003982068_00293_32411_1160.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_080210_000005672068_00293_32411_1227.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_082224_000006042068_00293_32411_1231.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_084311_000001022068_00293_32411_1229.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_084734_000006162068_00293_32411_1245.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_093235_000005192068_00294_32412_1252.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_094357_000000782068_00294_32412_1314.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_094434_000001872068_00294_32412_1377.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_095737_000001082068_00294_32412_1391.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_102231_000000782068_00294_32412_1389.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_103328_000003022068_00294_32412_1399.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_111313_000005732068_00295_32413_1425.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_112533_000001382068_00295_32413_1508.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_121621_000001632068_00295_32413_1513.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_122639_000002352068_00295_32413_1521.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_124825_000002772068_00296_32414_1523.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_125410_000005312068_00296_32414_1582.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_130223_000002592068_00296_32414_1659.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_132507_000006462068_00296_32414_1661.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_133606_000003622068_00296_32414_1663.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_134342_000009242068_00296_32414_1673.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_140732_000002772068_00296_32414_1671.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_142412_000007732068_00297_32415_1752.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_144729_000003982068_00297_32415_1783.N1					OK	OK	OK	OK

ASA_GM1_1PNPDK20080512_150633_000001502068_00297_32415_1788.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_152418_000004772068_00297_32415_1790.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_153428_000003442068_00297_32415_1798.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_160655_000004712068_00298_32416_1803.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_162443_000010992068_00298_32416_1991.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_170454_000002052068_00298_32416_1910.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_174806_000003982068_00299_32417_1919.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_180451_000000782068_00299_32417_2028.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_180941_000003802068_00299_32417_2030.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_184530_000004832068_00299_32417_2032.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_185901_000001442068_00299_32417_2034.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_192305_000003922068_00300_32418_2042.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20080512_193111_000002172068_00300_32418_2049.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_IMM_1PNPDE20080512_001204_000000792068_00288_32406_7827.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_001946_000003012068_00288_32406_7832.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_001946_000003802068_00288_32406_7846.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_002548_000000182068_00288_32406_7811.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_002646_000003312068_00288_32406_7844.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_015009_000000502068_00289_32407_7955.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_015109_000001092068_00289_32407_7951.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_020046_000004742068_00289_32407_7986.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_024251_000002082068_00290_32408_8102.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_025323_000000372068_00290_32408_8092.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_031042_000001812068_00290_32408_8018.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_034106_000003212068_00290_32408_8117.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_034706_000003812068_00290_32408_8289.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_045014_000001312068_00291_32409_8249.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_045239_000001742068_00291_32409_8268.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_052207_000001402068_00291_32409_8270.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_052607_000004802068_00291_32409_8445.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_060618_000000662068_00292_32410_8409.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_060825_000000812068_00292_32410_8353.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_070329_000002612068_00292_32410_8453.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_095214_000000372068_00294_32412_8481.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_095926_000002402068_00294_32412_8494.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_095926_000003012068_00294_32412_8527.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_102350_000004412068_00294_32412_8515.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_103045_000001452068_00294_32412_8543.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_104414_000000512068_00294_32412_8537.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_114015_000000742068_00295_32413_8529.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_120346_000002602068_00295_32413_8563.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_140431_000001412068_00296_32414_8611.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_141219_000000362068_00296_32414_8585.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_142234_000000802068_00297_32415_8609.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_145404_000000512068_00297_32415_8593.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_153218_000001132068_00297_32415_8583.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_160446_000001132068_00298_32416_8621.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_170818_000002602068_00298_32416_8691.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_171120_000000782068_00298_32416_8673.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_171318_000003752068_00298_32416_8805.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_171920_000000132068_00298_32416_8643.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_174433_000001942068_00299_32417_8699.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_181602_000001552068_00299_32417_9784.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_185335_000000622068_00299_32417_8679.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_185335_000003092068_00299_32417_8807.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_185637_000000592068_00299_32417_8685.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_202829_000001512068_00300_32418_8830.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_211134_000000502068_00301_32419_8957.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_213342_000000812068_00301_32419_8965.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_221402_000003682068_00301_32419_8983.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_224722_000000512068_00302_32420_8963.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_234813_000000802068_00302_32420_9125.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_235013_000000802068_00302_32420_9008.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20080512_235213_000004892068_00302_32420_9166.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080512_070930_000002712068_00292_32410_1193.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080512_074940_000001632068_00293_32411_1207.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080512_075239_000000392068_00293_32411_1195.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080512_084456_000001402068_00293_32411_1355.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080512_094112_000000812068_00294_32412_1312.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080512_094304_000000362068_00294_32412_1241.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080512_094739_000000372068_00294_32412_1346.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080512_095131_000000822068_00294_32412_1370.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080512_120846_000004382068_00295_32413_1653.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080512_143943_000000662068_00297_32415_1758.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080512_193743_000000512068_00300_32418_2121.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20080512_211134_000000672068_00301_32419_2156.N1					OK	OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_WSM_1PNPDE20080512_110848_000002442068_00295_32413_8569.N1		OK	OK	OK
ASA_WSM_1PNPDE20080512_110848_000002442068_00295_32413_8577.N1		OK	OK	OK
ASA_WSM_1PNPDE20080512_113442_000000852068_00295_32413_8541.N1		OK	OK	OK
ASA_WSM_1PNPDE20080512_142113_000000672068_00297_32415_8587.N1		OK	OK	OK
ASA_WSM_1PNPDE20080512_145532_000002252068_00297_32415_8625.N1		OK	OK	OK
ASA_WSM_1PNPDE20080512_155715_000000672068_00297_32415_8627.N1		OK	OK	OK
ASA_WSM_1PNPDE20080512_155715_000000862068_00297_32415_8803.N1		OK	OK	OK
ASA_WSM_1PNPDE20080512_160304_000000852068_00298_32416_8623.N1		OK	OK	OK
ASA_WSM_1PNPDE20080512_180617_000000672068_00299_32417_8693.N1		OK	OK	OK
ASA_WSM_1PNPDE20080512_180617_000001832068_00299_32417_8828.N1		OK	OK	OK
ASA_WSM_1PNPDE20080512_180825_000000552068_00299_32417_8697.N1		OK	OK	OK
ASA_WSM_1PNPDE20080512_191919_000002142068_00300_32418_8865.N1		OK	OK	OK
ASA_WSM_1PNPDE20080512_204658_000005742068_00300_32418_8967.N1		OK	OK	OK
ASA_WSM_1PNPDE20080512_204658_000005742068_00300_32418_9123.N1		OK	OK	OK
ASA_WSM_1PNPDE20080512_230127_000002442068_00302_32420_9378.N1		OK	OK	OK
ASA_WSM_1PNPDE20080512_230234_000001762068_00302_32420_9168.N1		OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20080512_001330_000002702068_00288_32406_7700.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_003453_000003892068_00288_32406_7707.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_004038_000004192068_00288_32406_7864.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_005111_000007342068_00288_32406_7855.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_013245_000008852068_00289_32407_7877.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_015306_000003302068_00289_32407_7874.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_021529_000001052068_00289_32407_7867.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_021629_000003152068_00289_32407_7995.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_023539_000003892068_00290_32408_8021.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_031908_000008892068_00290_32408_8016.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_032217_000006292068_00290_32408_8013.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_033232_000002402068_00290_32408_8136.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_040031_000009442068_00290_32408_8145.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_041830_000000742068_00291_32409_8166.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_045959_000008392068_00291_32409_8184.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_051343_000003752068_00291_32409_8307.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_053641_000015442068_00291_32409_8341.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_064411_000006442068_00292_32410_8344.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_195224_000019792068_00300_32418_8710.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_204205_000002392068_00300_32418_8738.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_204520_000000452068_00300_32418_8861.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_213511_000018442068_00301_32419_8884.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_222241_000004192068_00301_32419_8879.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_222841_000006892068_00301_32419_9001.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_224819_000004502068_00302_32420_9006.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_231322_000013042068_00302_32420_9017.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20080512_234119_000003152068_00302_32420_9020.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_065441_000003452068_00292_32410_1144.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_071717_000019042068_00292_32410_1163.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_083228_000005252068_00293_32411_1234.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_085753_000020242068_00293_32411_1255.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_100435_000010192068_00294_32412_1397.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_103829_000003002068_00294_32412_1394.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_104512_000013642068_00294_32412_1428.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_112755_000003602068_00295_32413_1503.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_113605_000002092068_00295_32413_1506.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_114136_000012442068_00295_32413_1516.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_121905_000004052068_00295_32413_1519.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_123038_000010212068_00295_32413_1526.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_130946_000008692068_00296_32414_1666.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_135941_000002552068_00296_32414_1669.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_141302_000004342068_00296_32414_1687.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_145917_000003892068_00297_32415_1786.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_150904_000008692068_00297_32415_1793.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_154017_000009742068_00297_32415_1796.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_155839_000002092068_00298_32416_1801.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_164303_000012592068_00298_32416_1908.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_172044_000013942068_00298_32416_1922.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_181844_000015592068_00299_32417_2040.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_190129_000000602068_00299_32417_2037.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20080512_190501_000007642068_00299_32417_2052.N1					OK	OK	OK	OK

### Calibration pulses for GM1 SS3 H/H

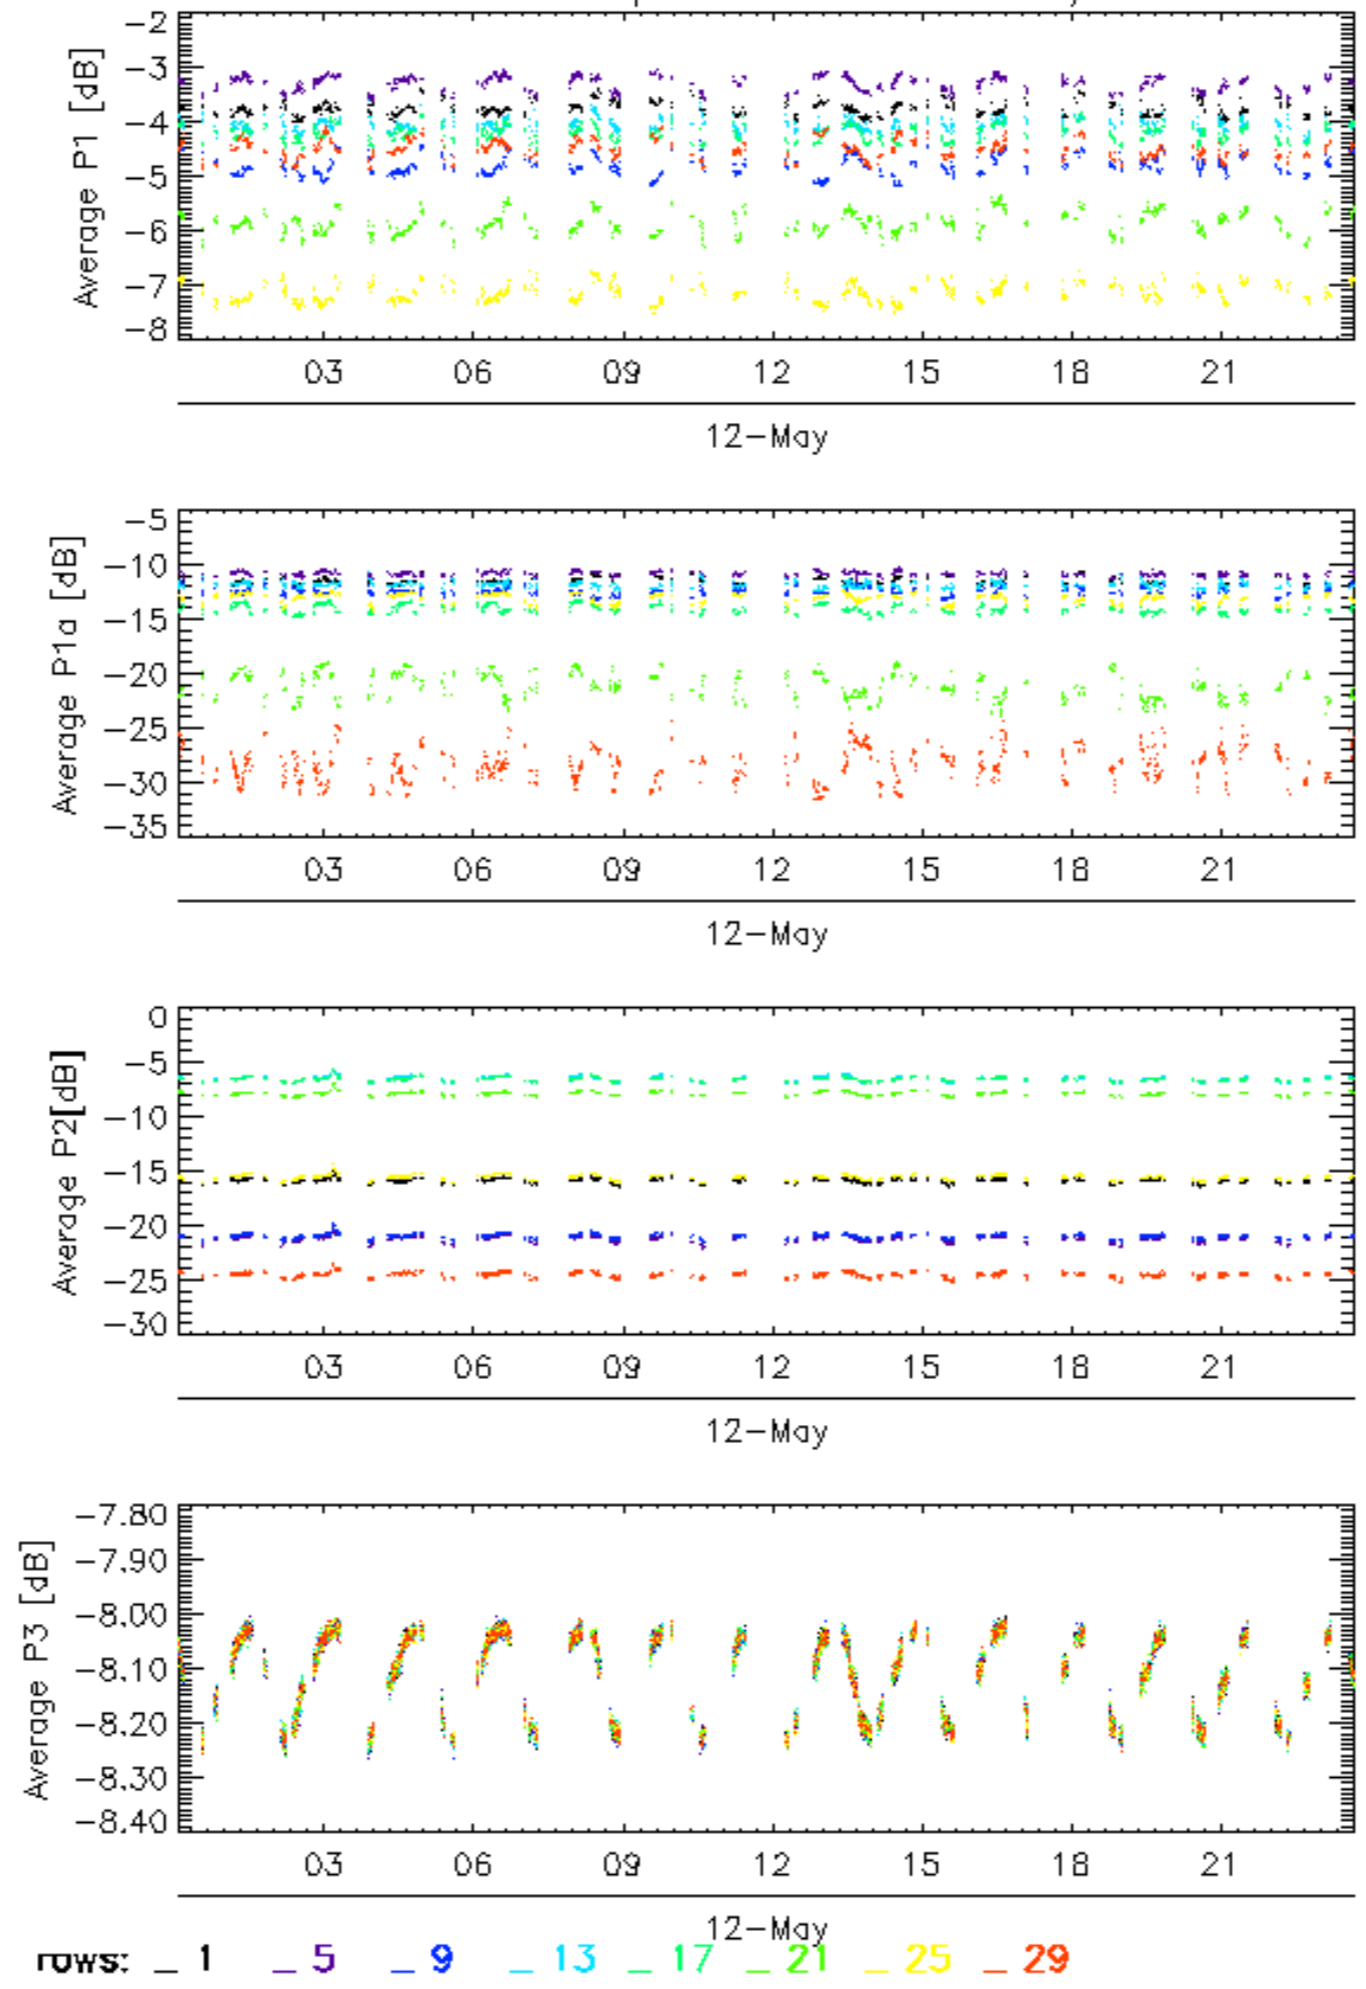


Calibration pulses for GM1 SS3 H/H

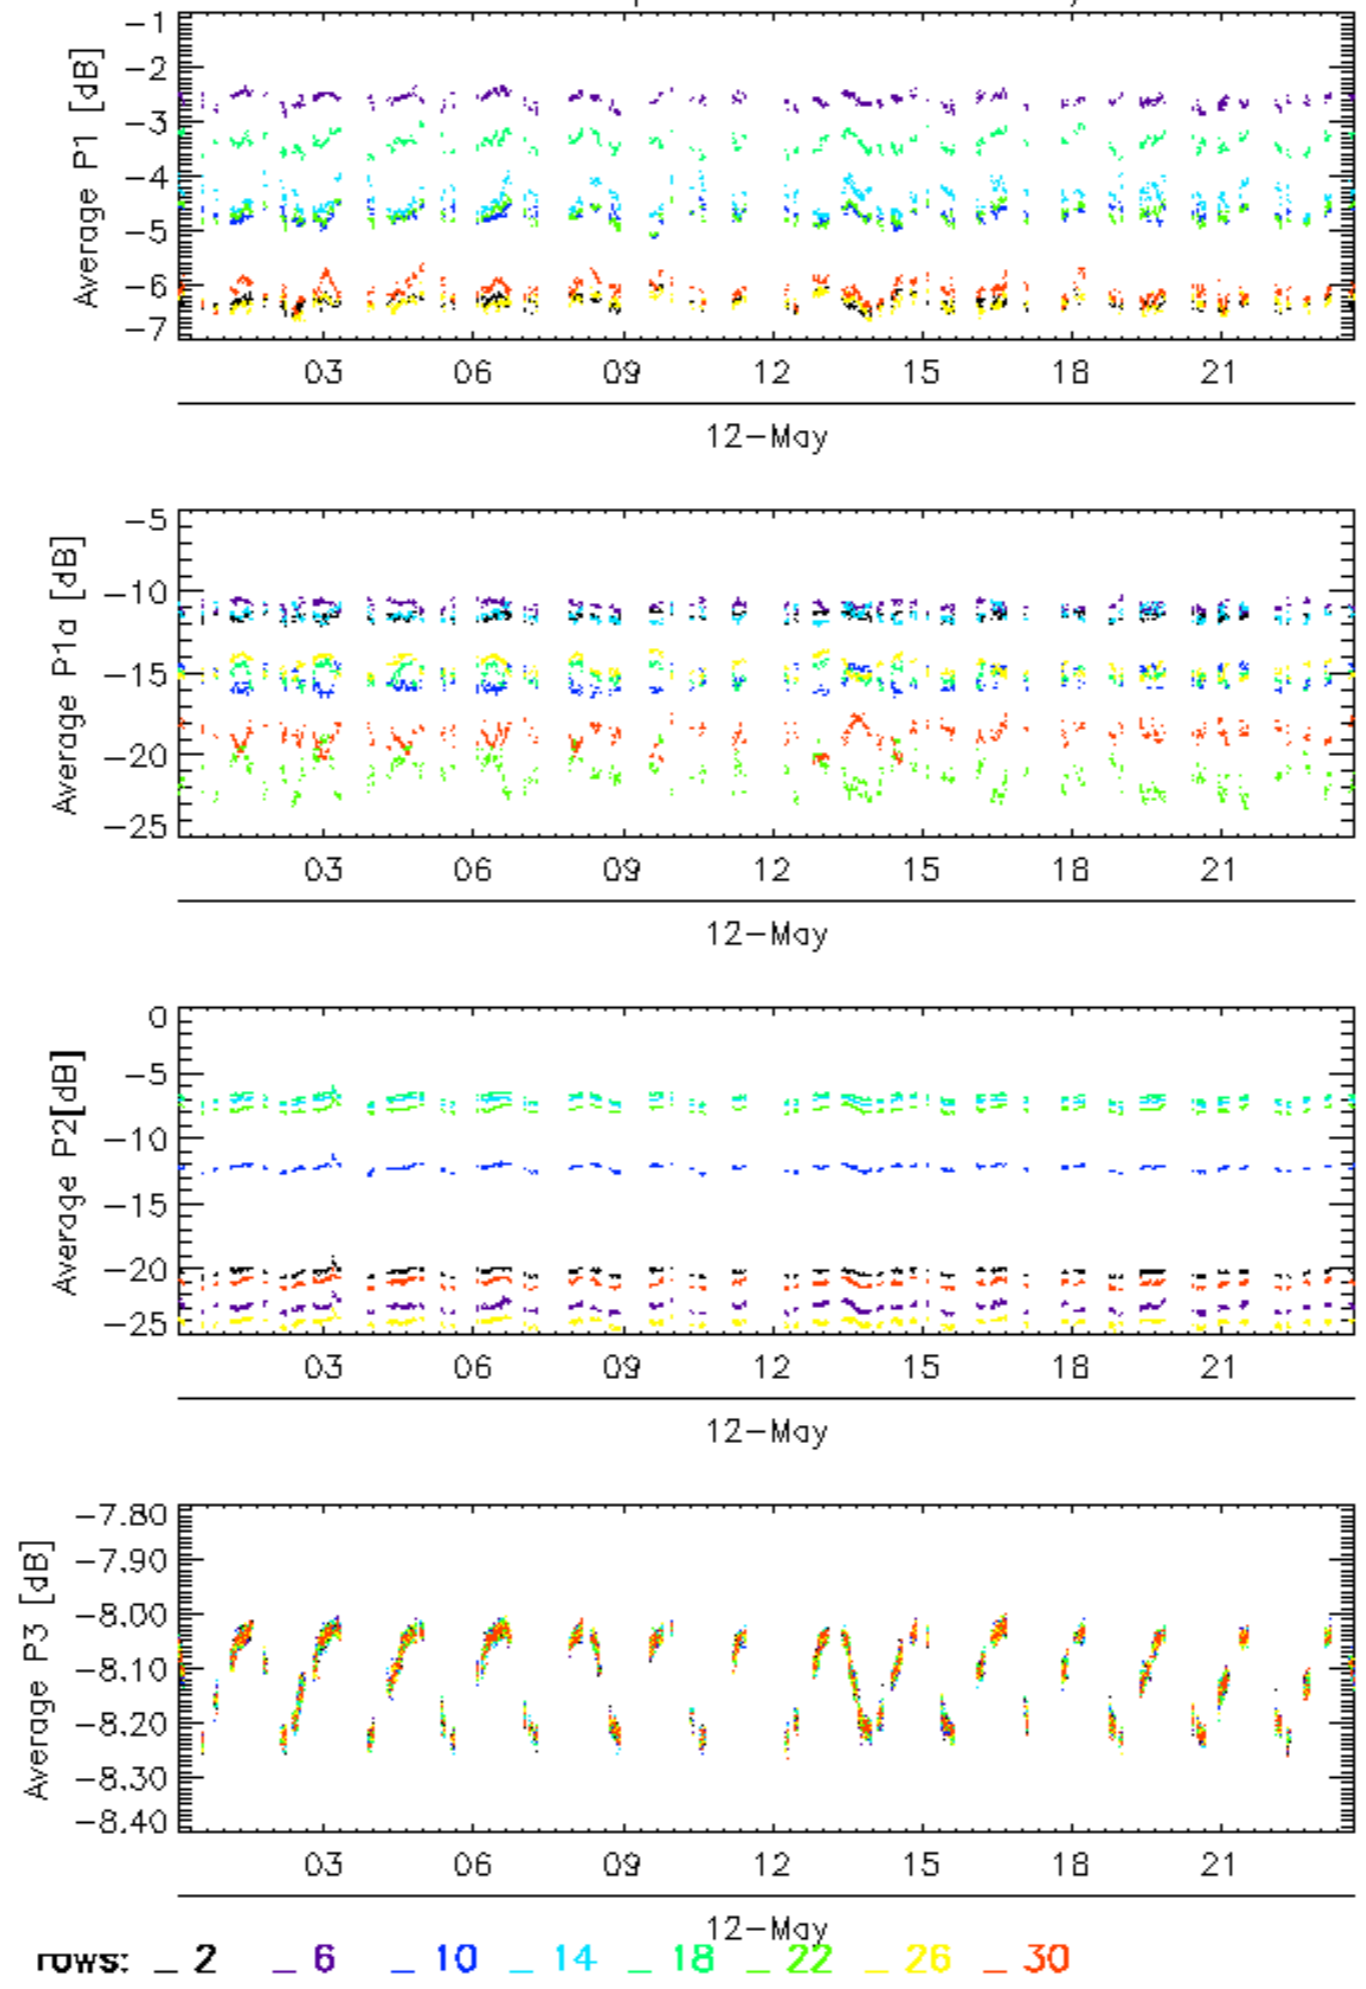





Calibration pulses for GM1 SS3 H/H

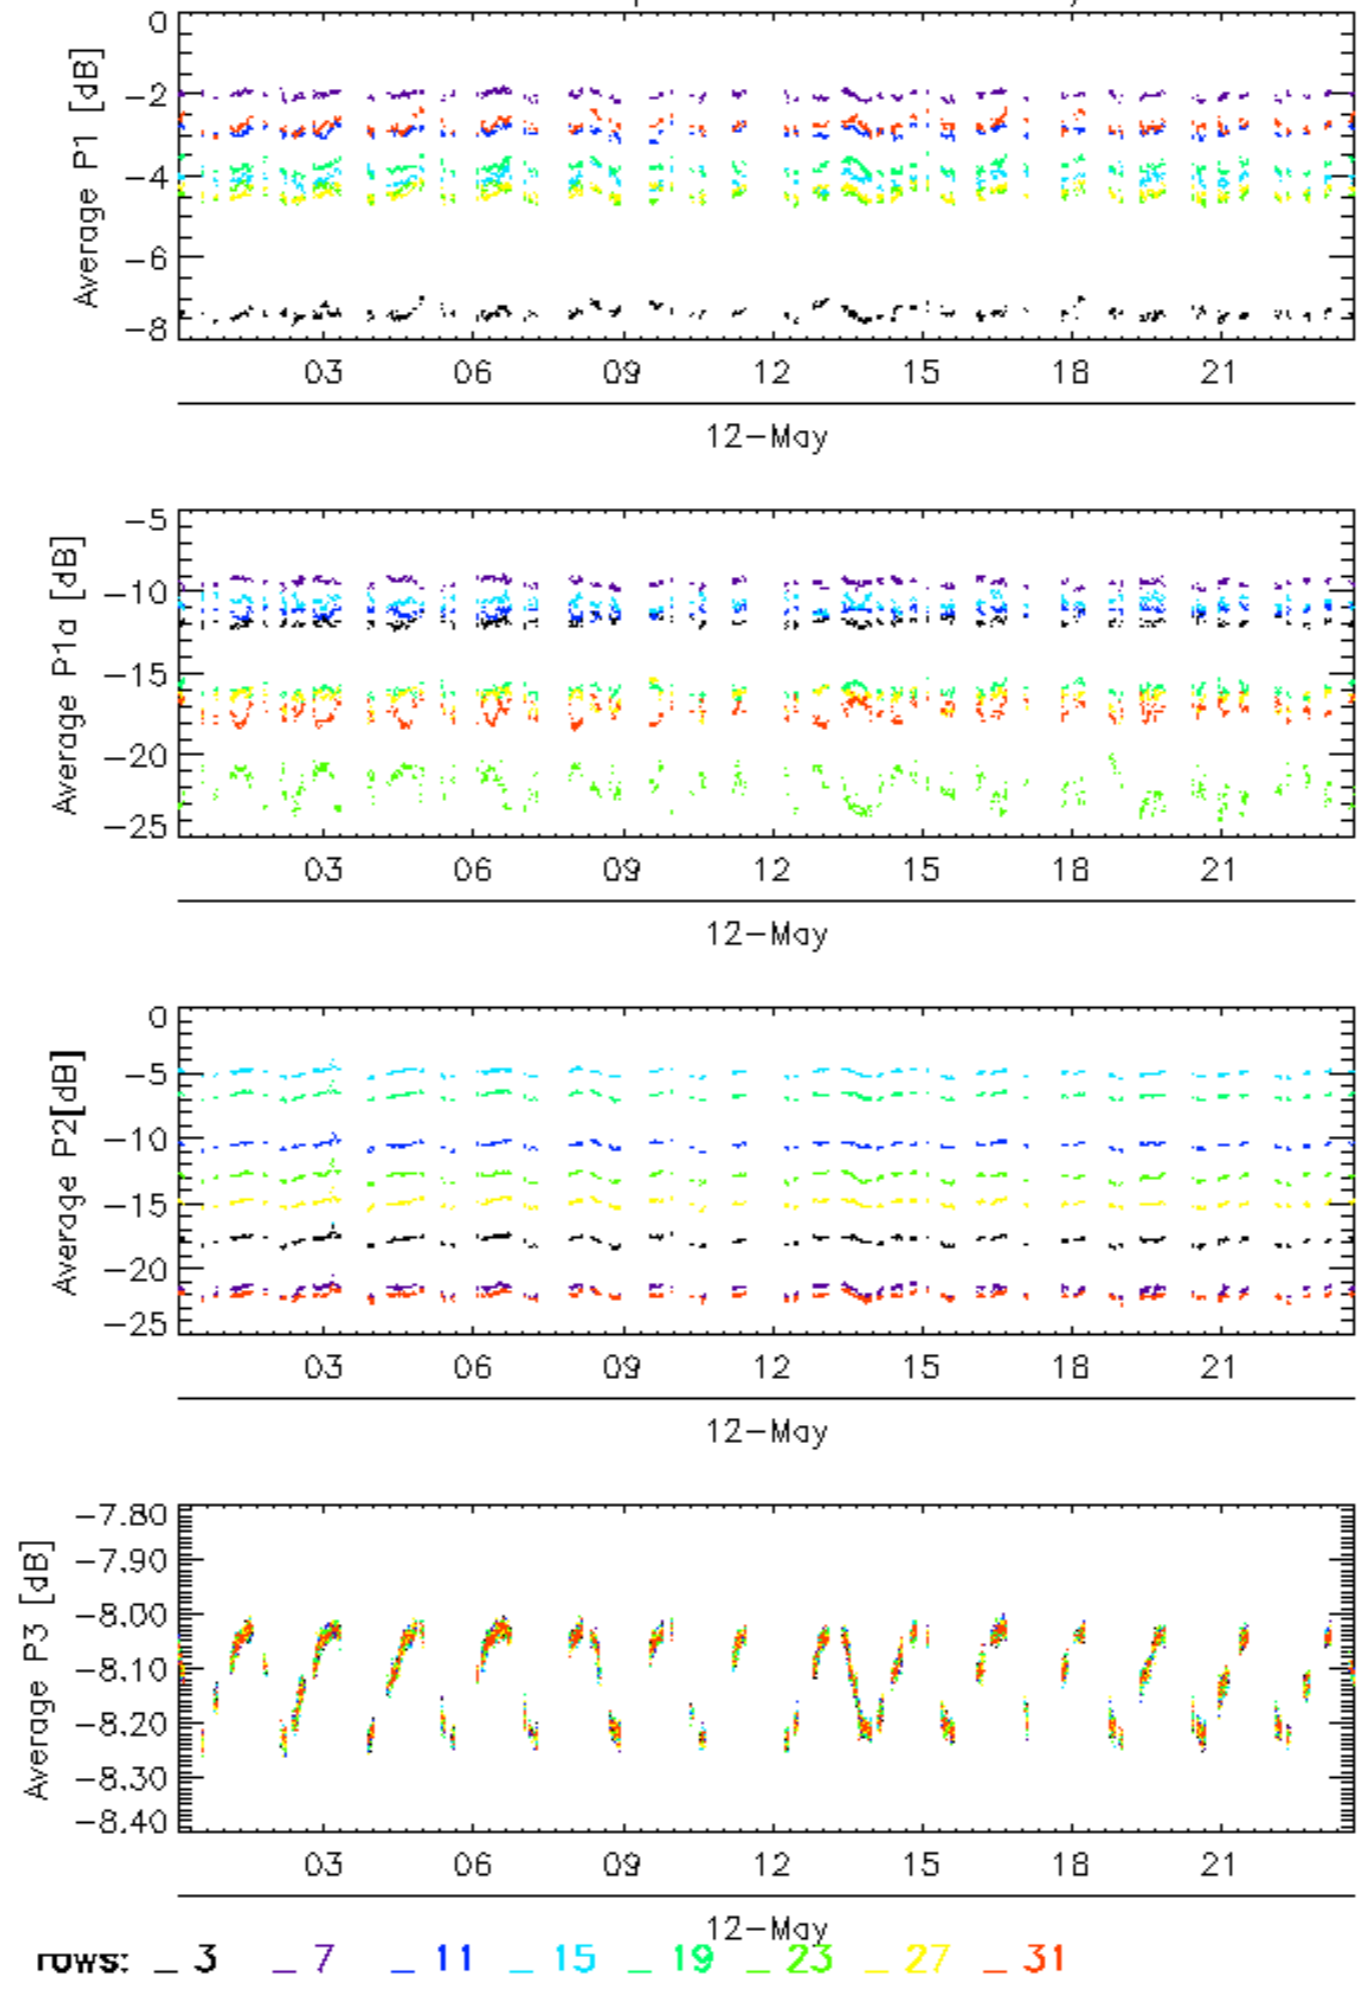


Calibration pulses for GM1 SS3 H/H

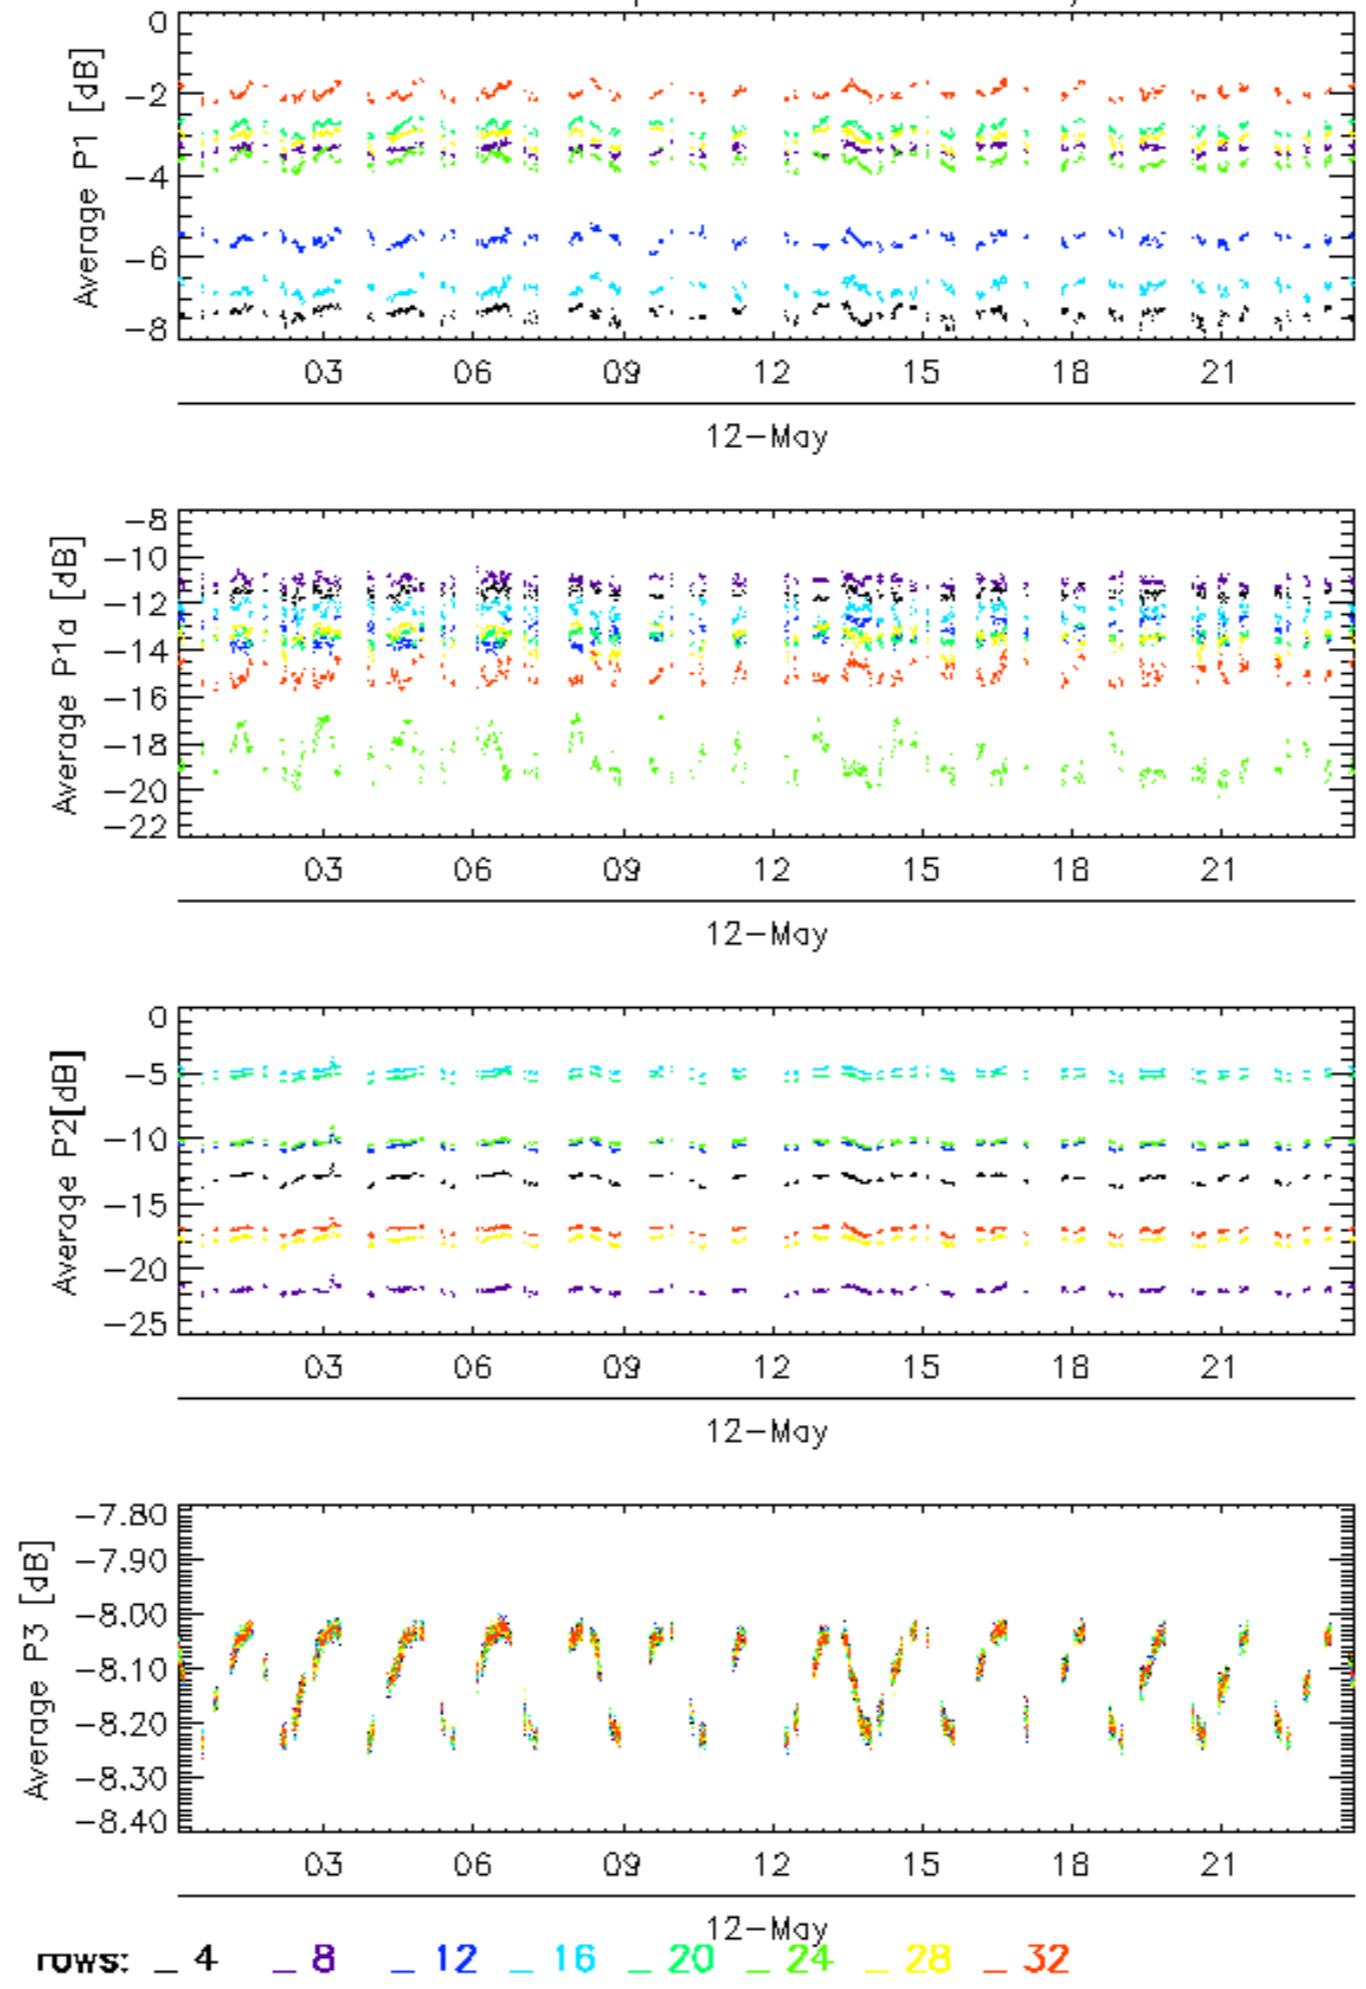


Calibration pulses for WVS IS2 V/V

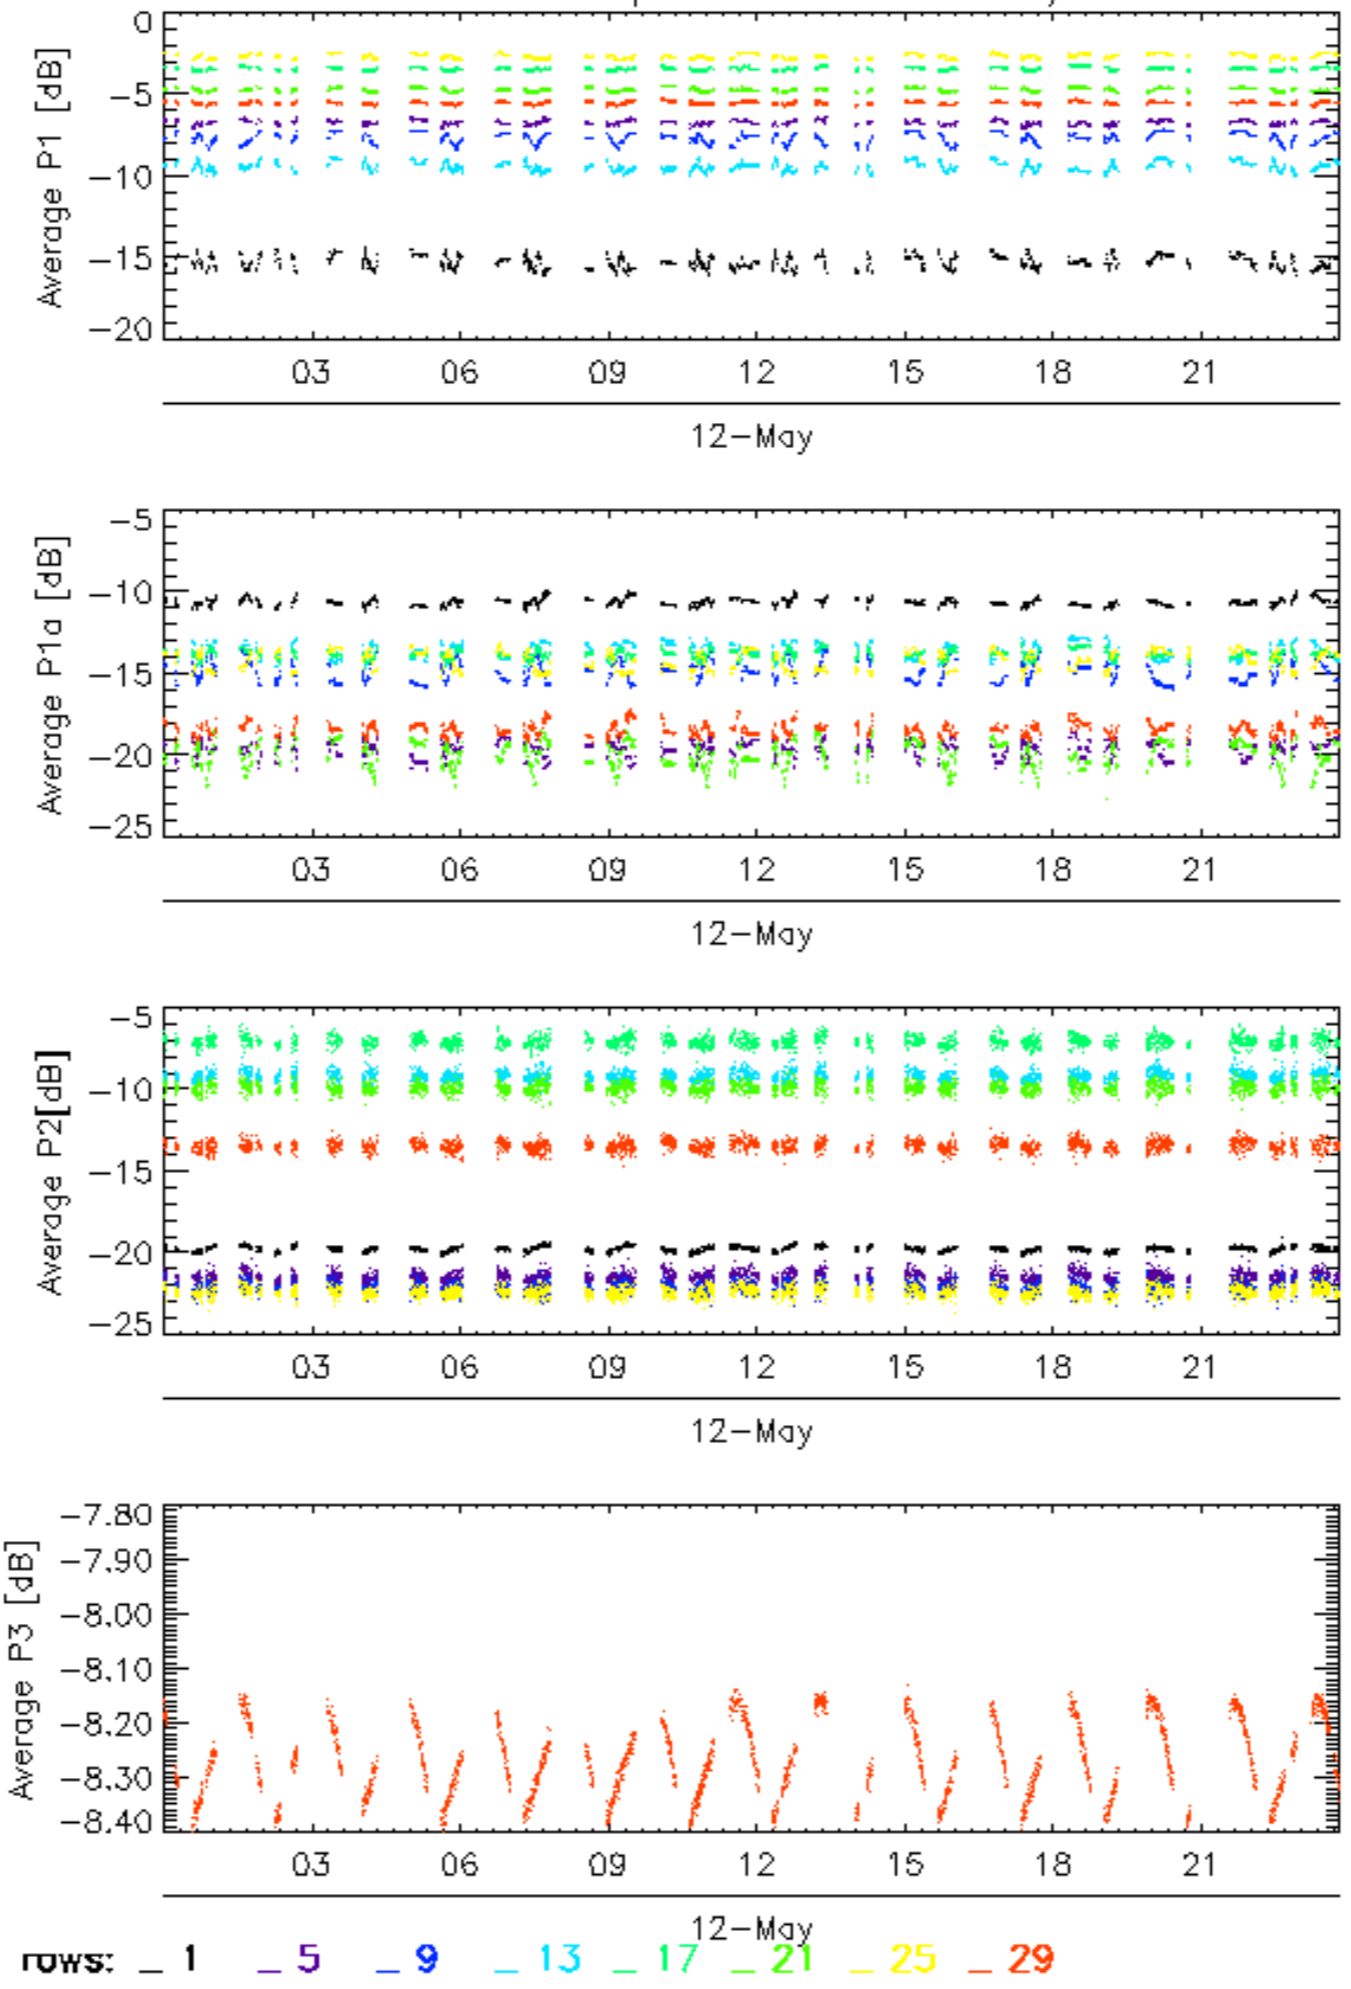


Calibration pulses for WVS IS2 V/V

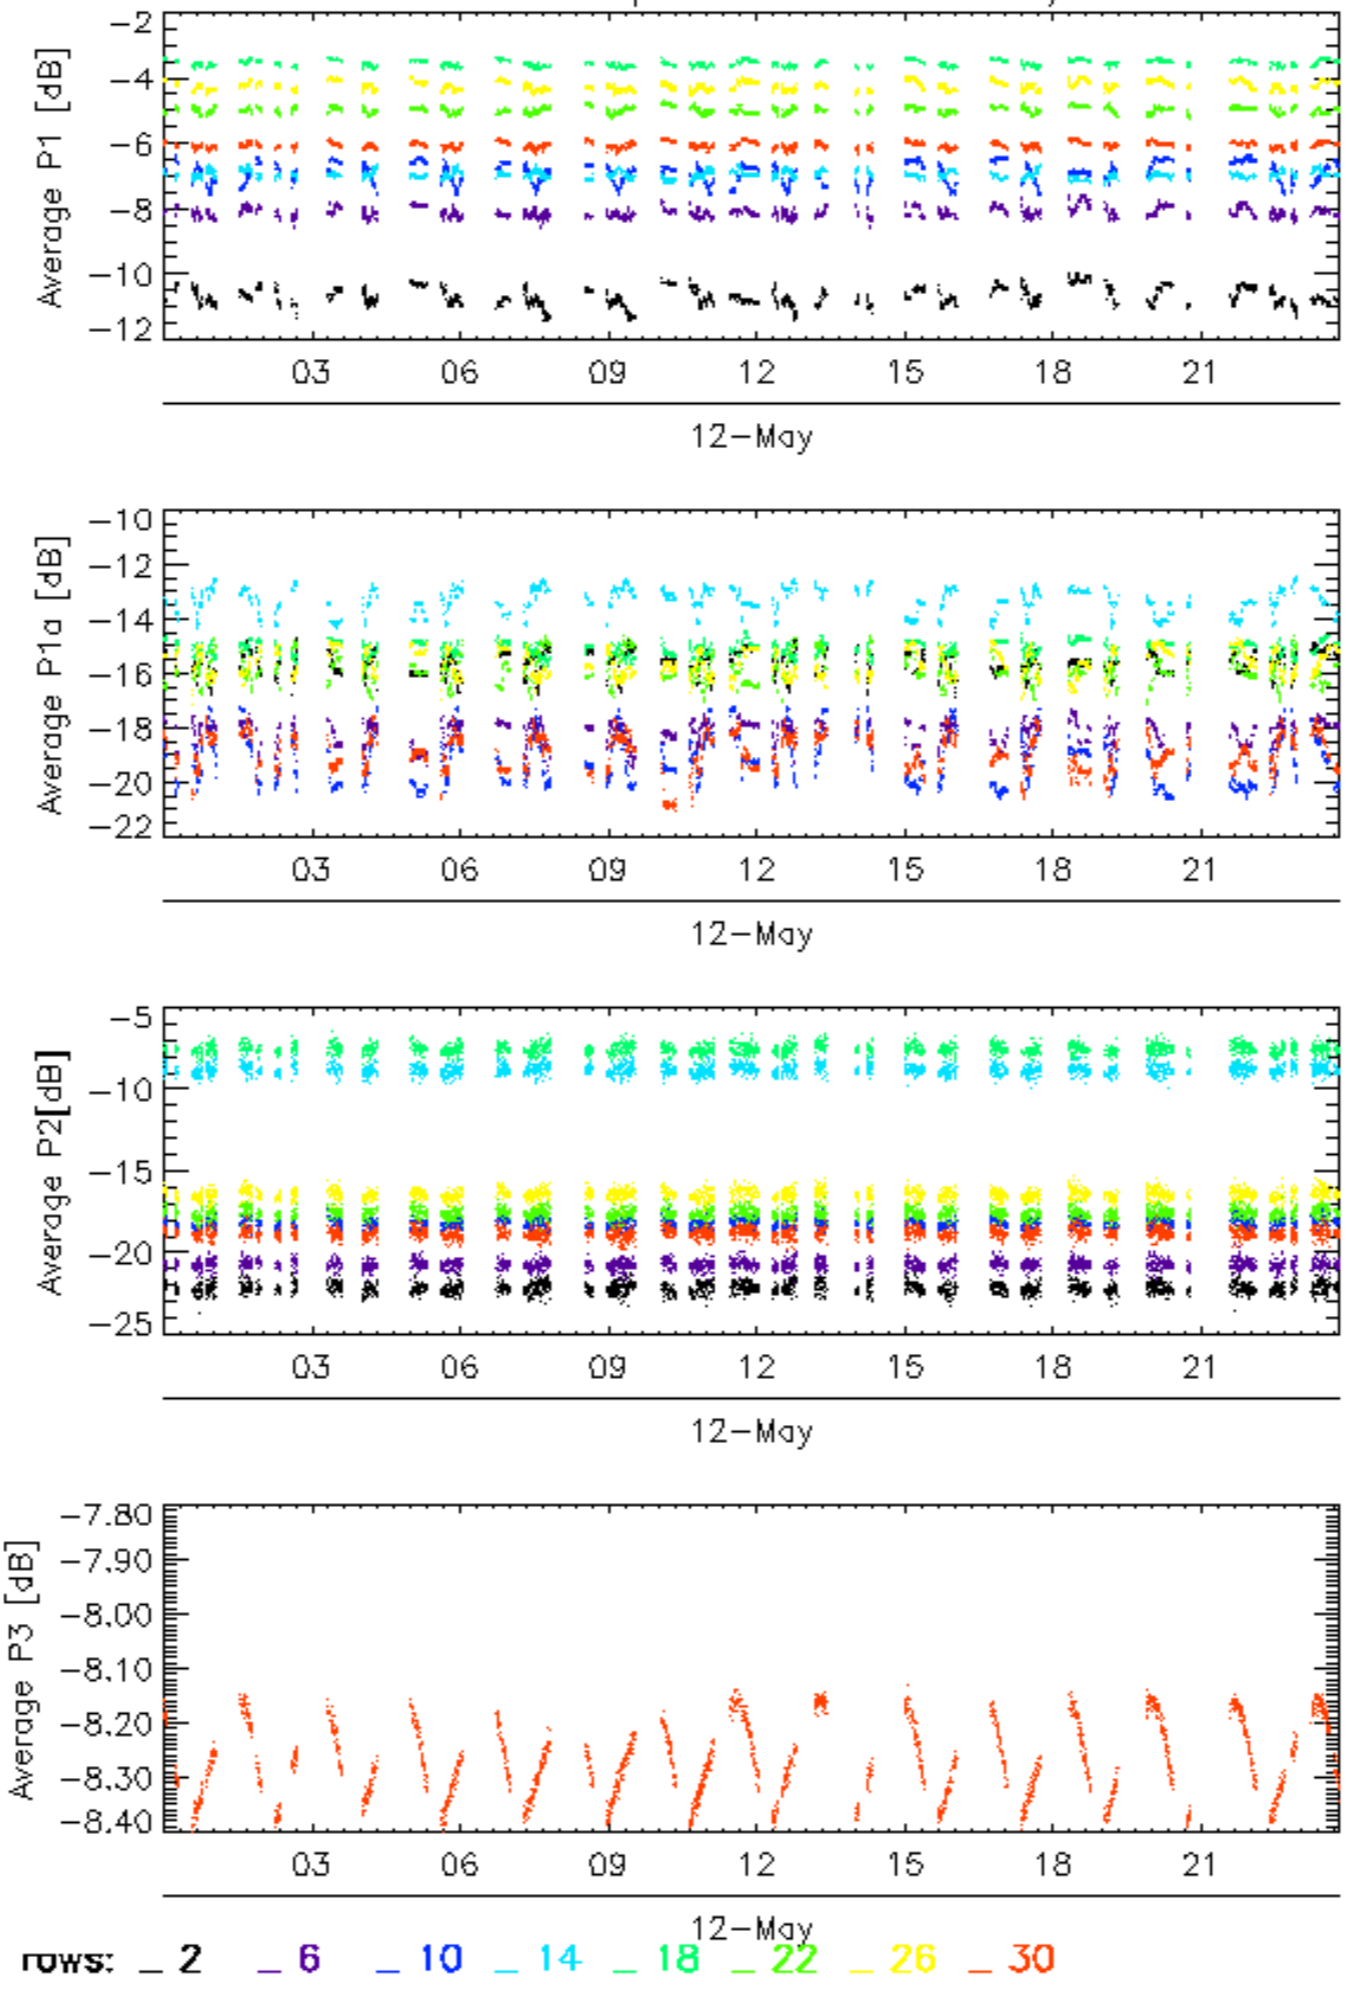



Calibration pulses for WVS IS2 V/V

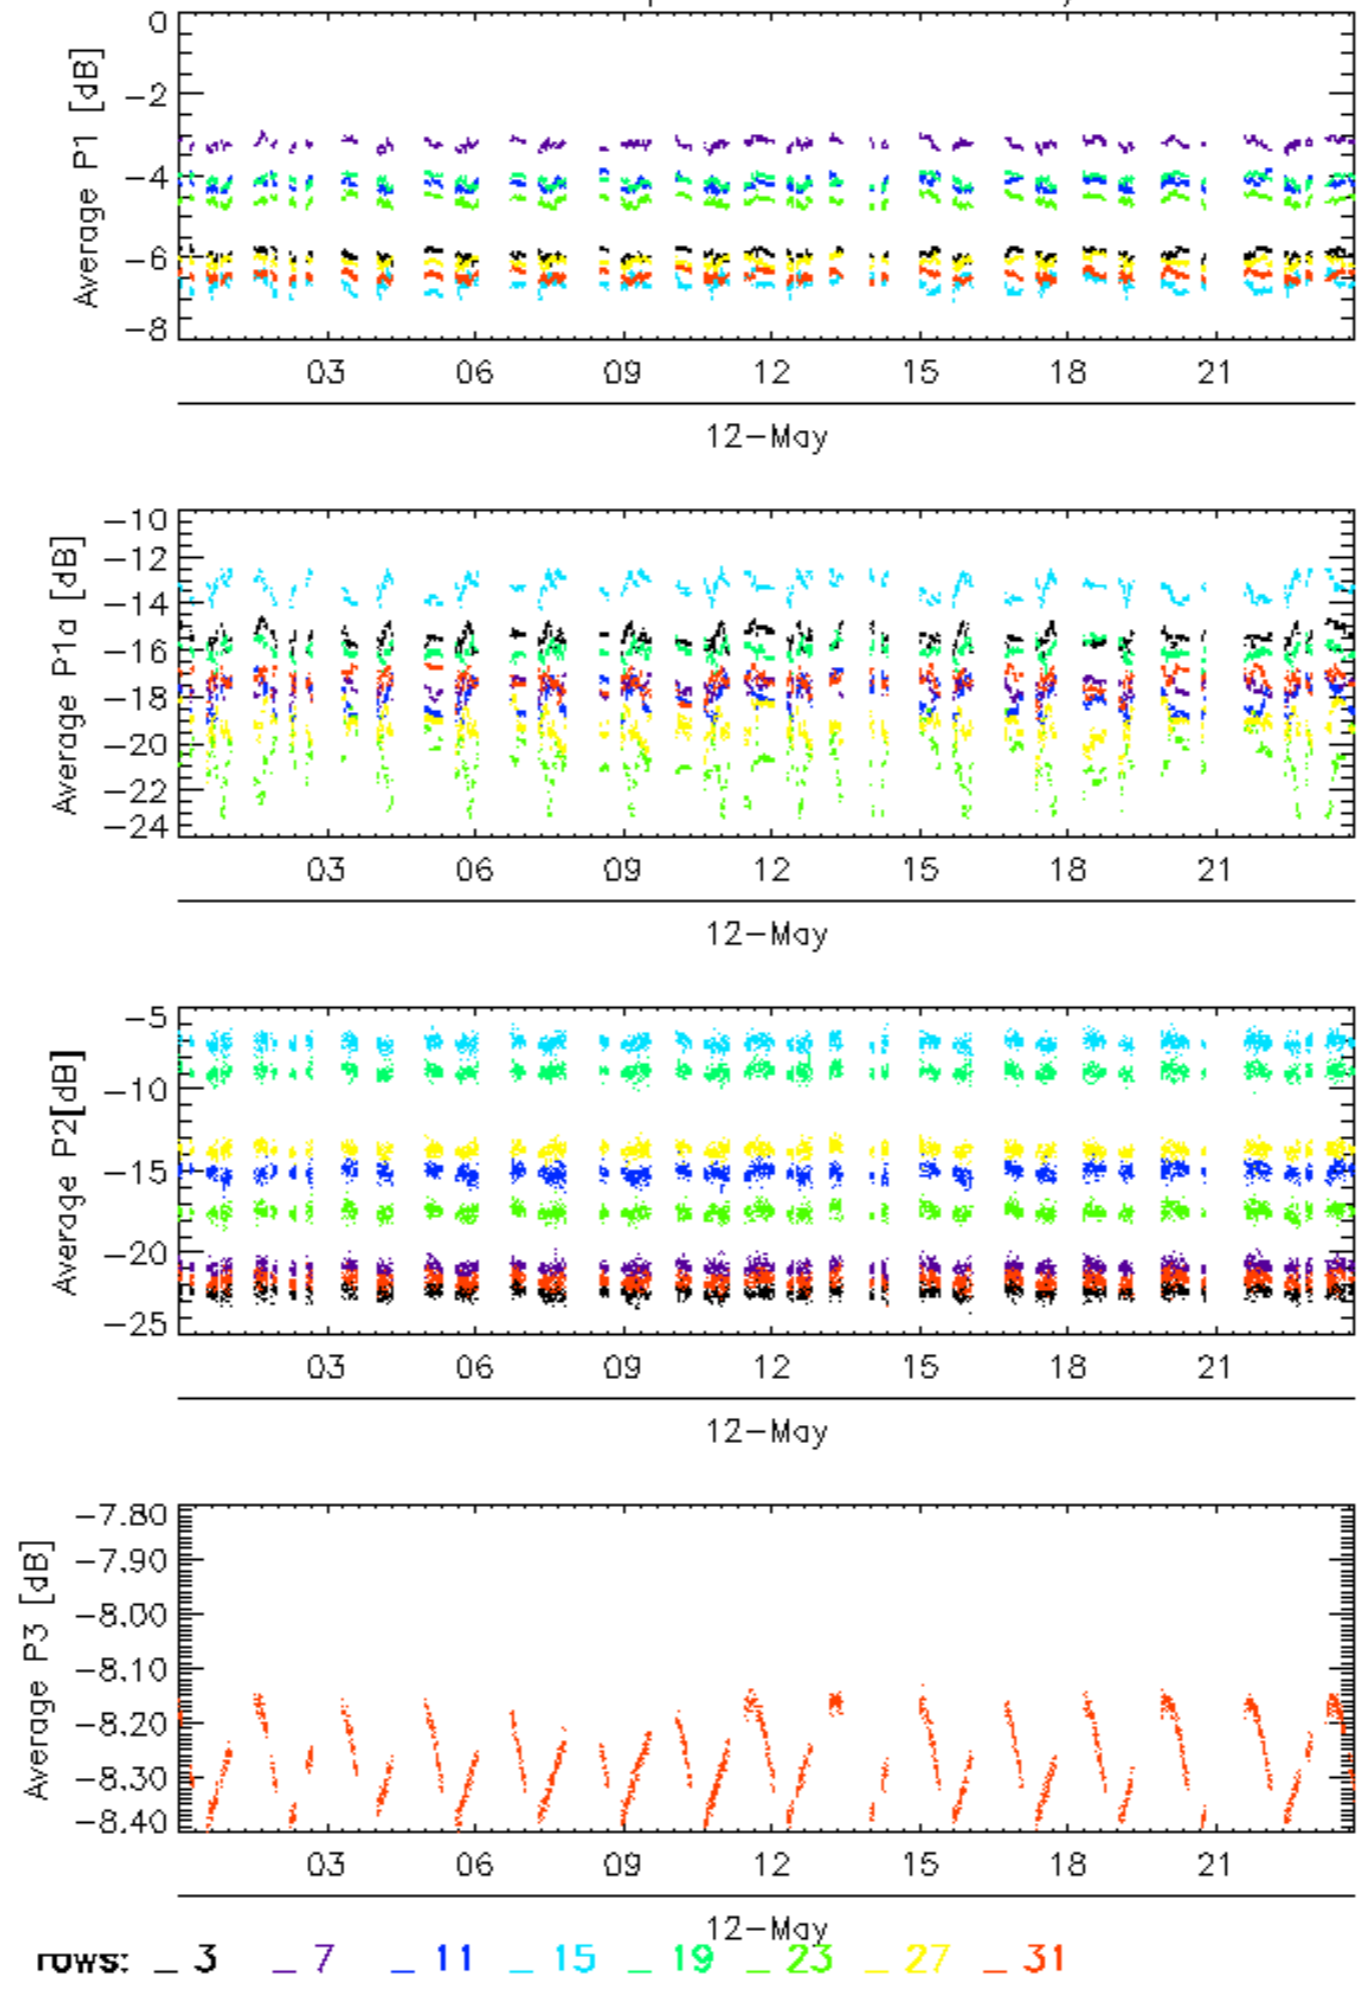



### Calibration pulses for WVS IS2 V/V

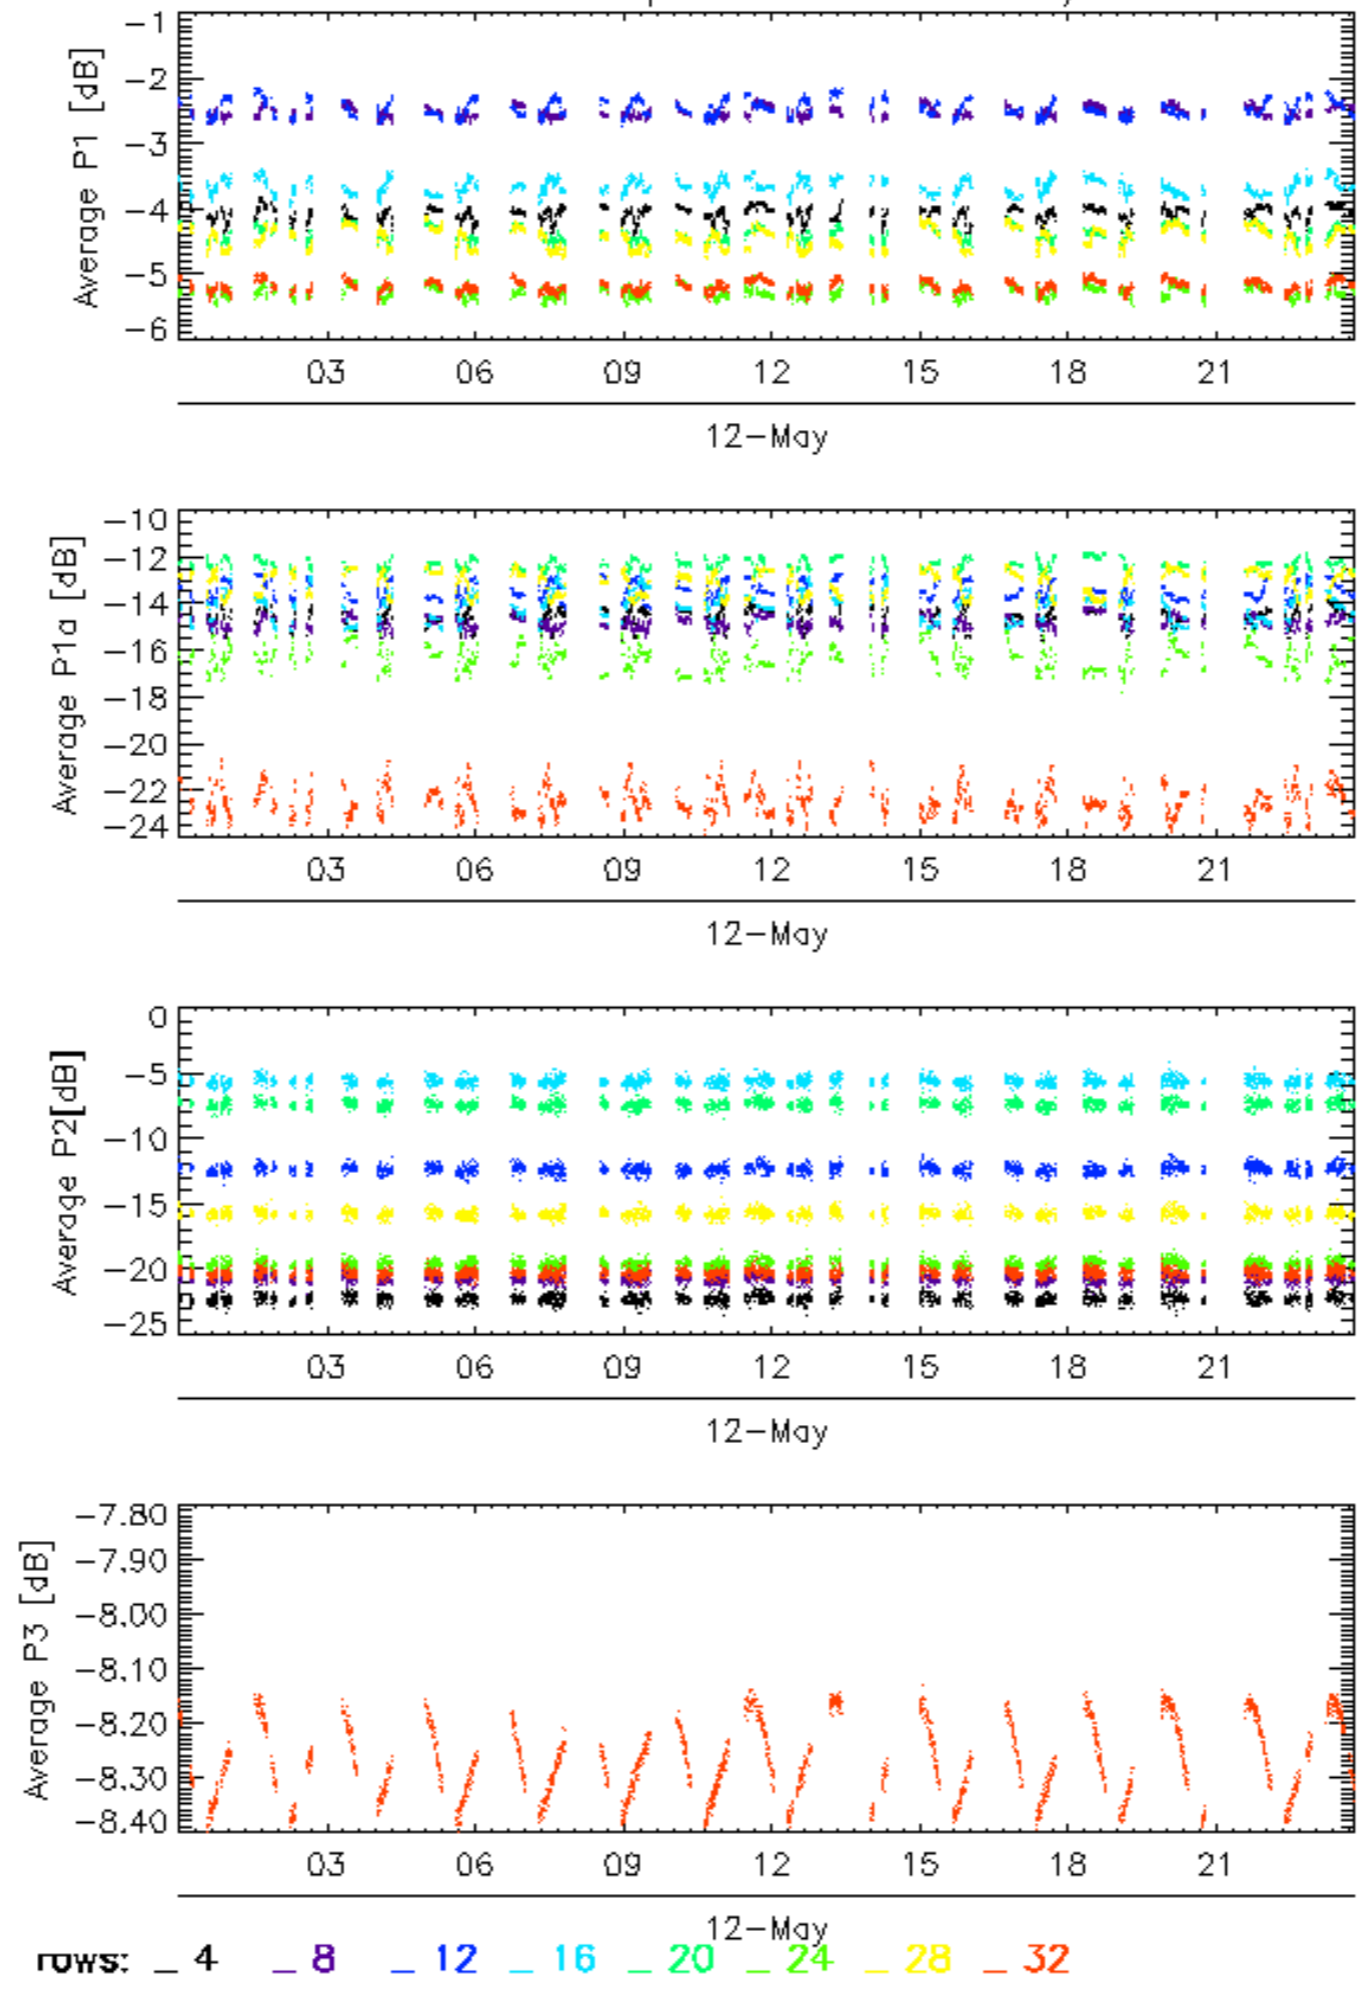


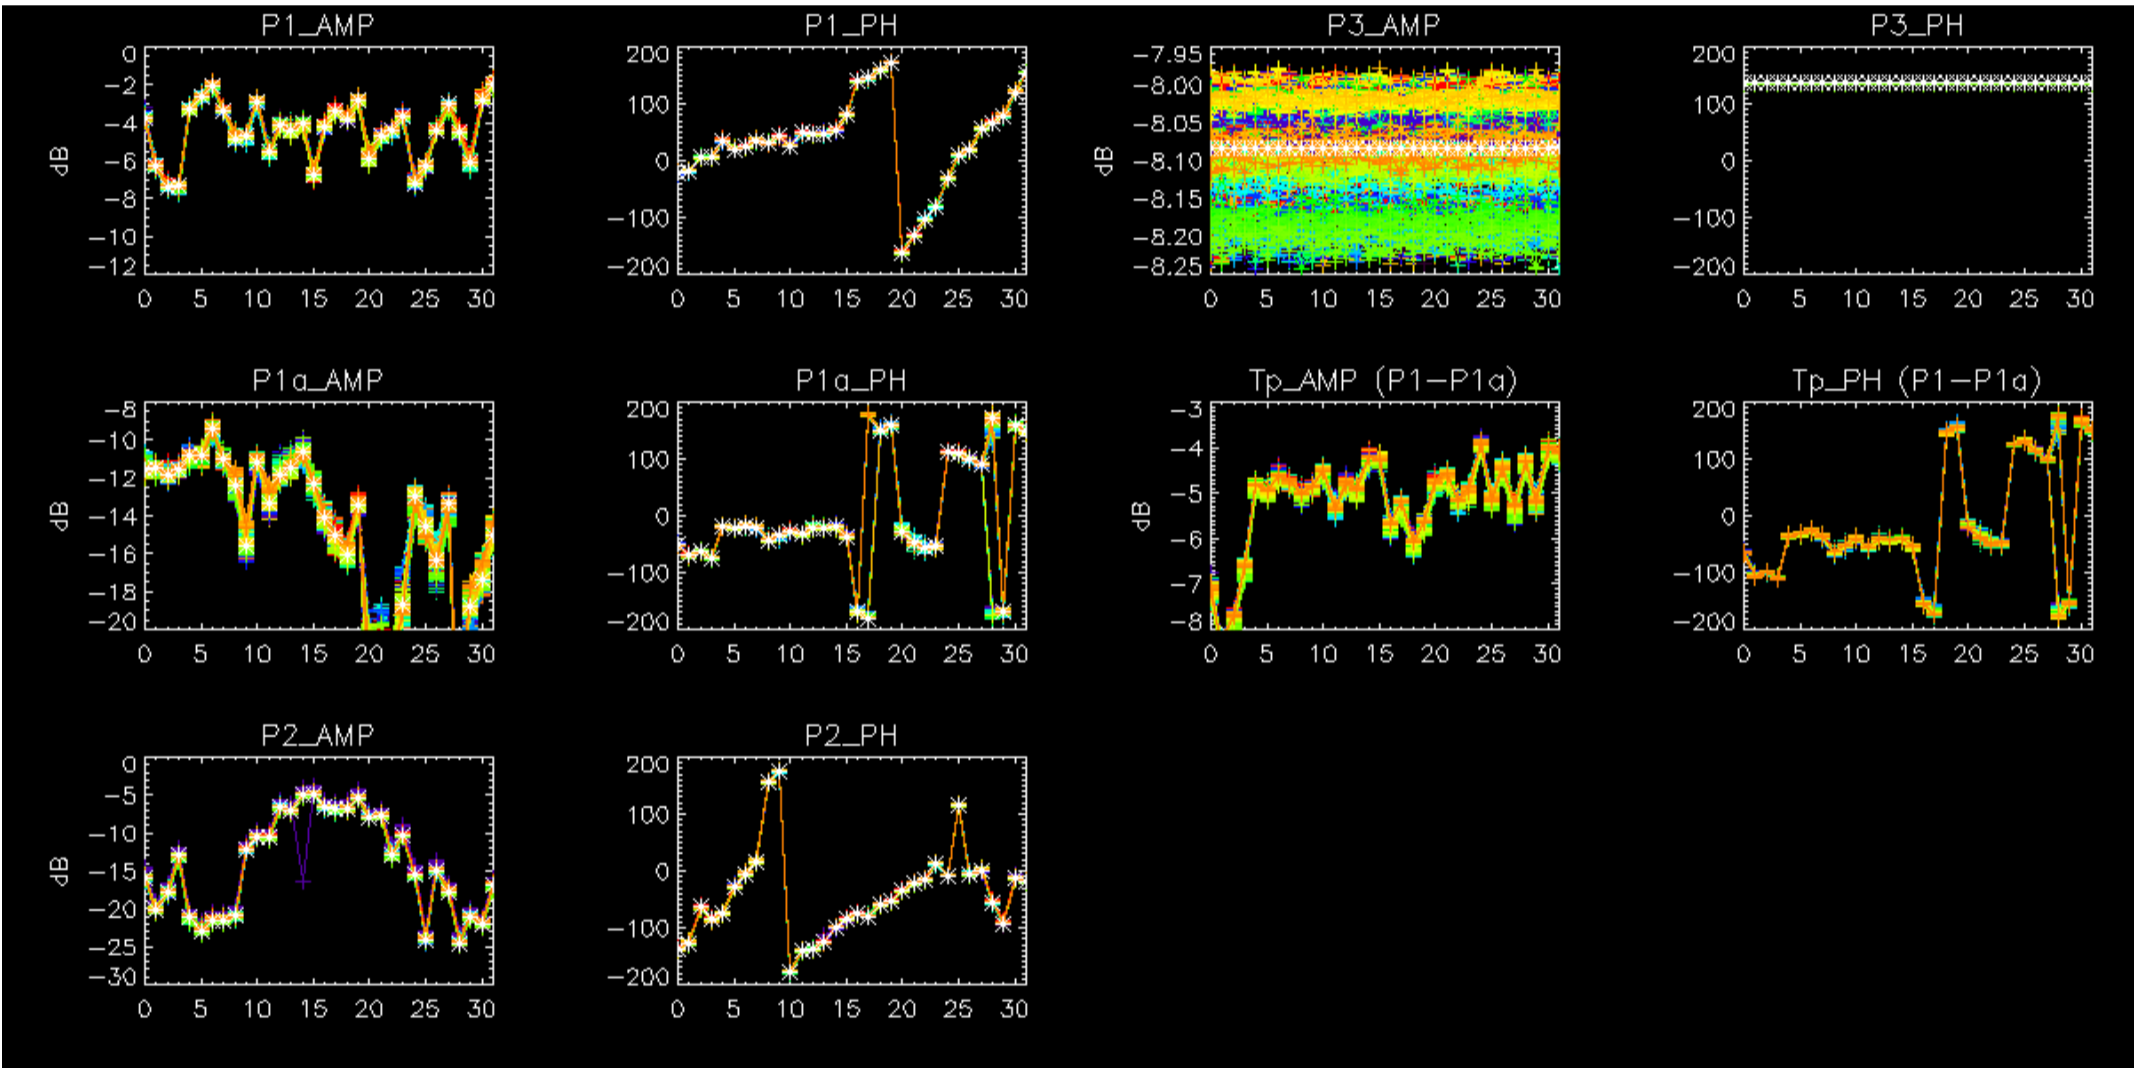



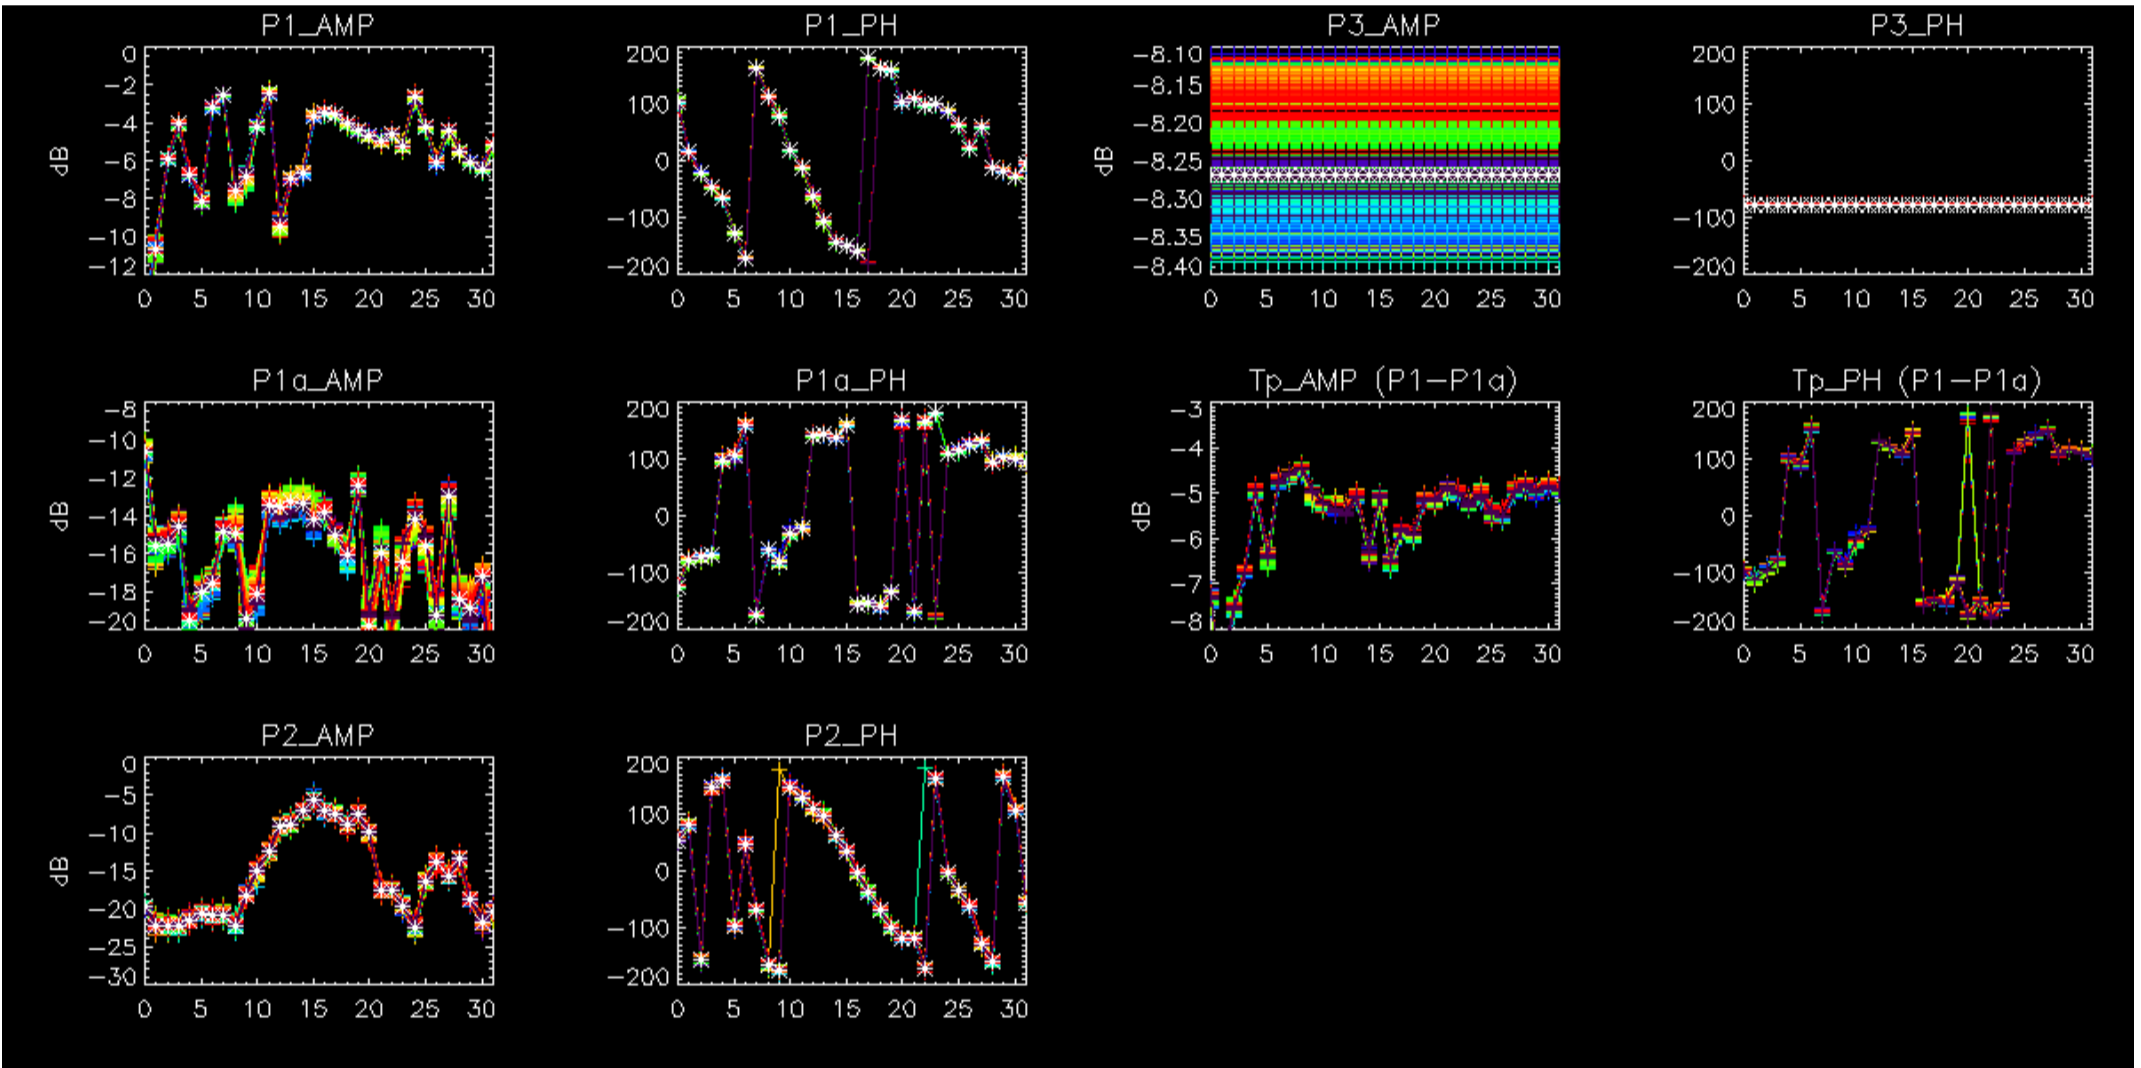






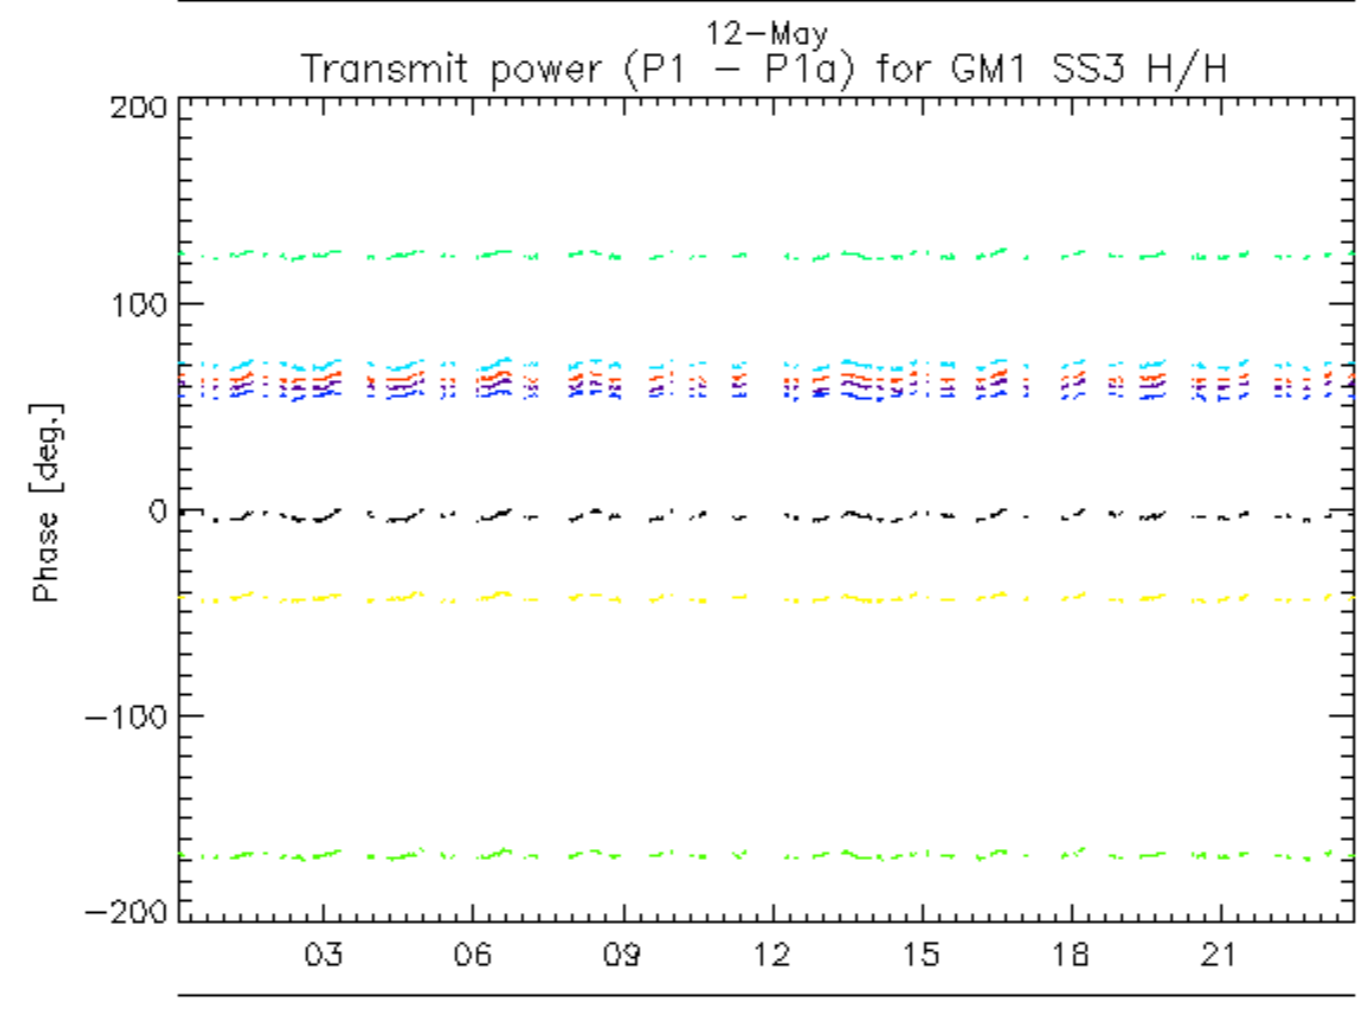
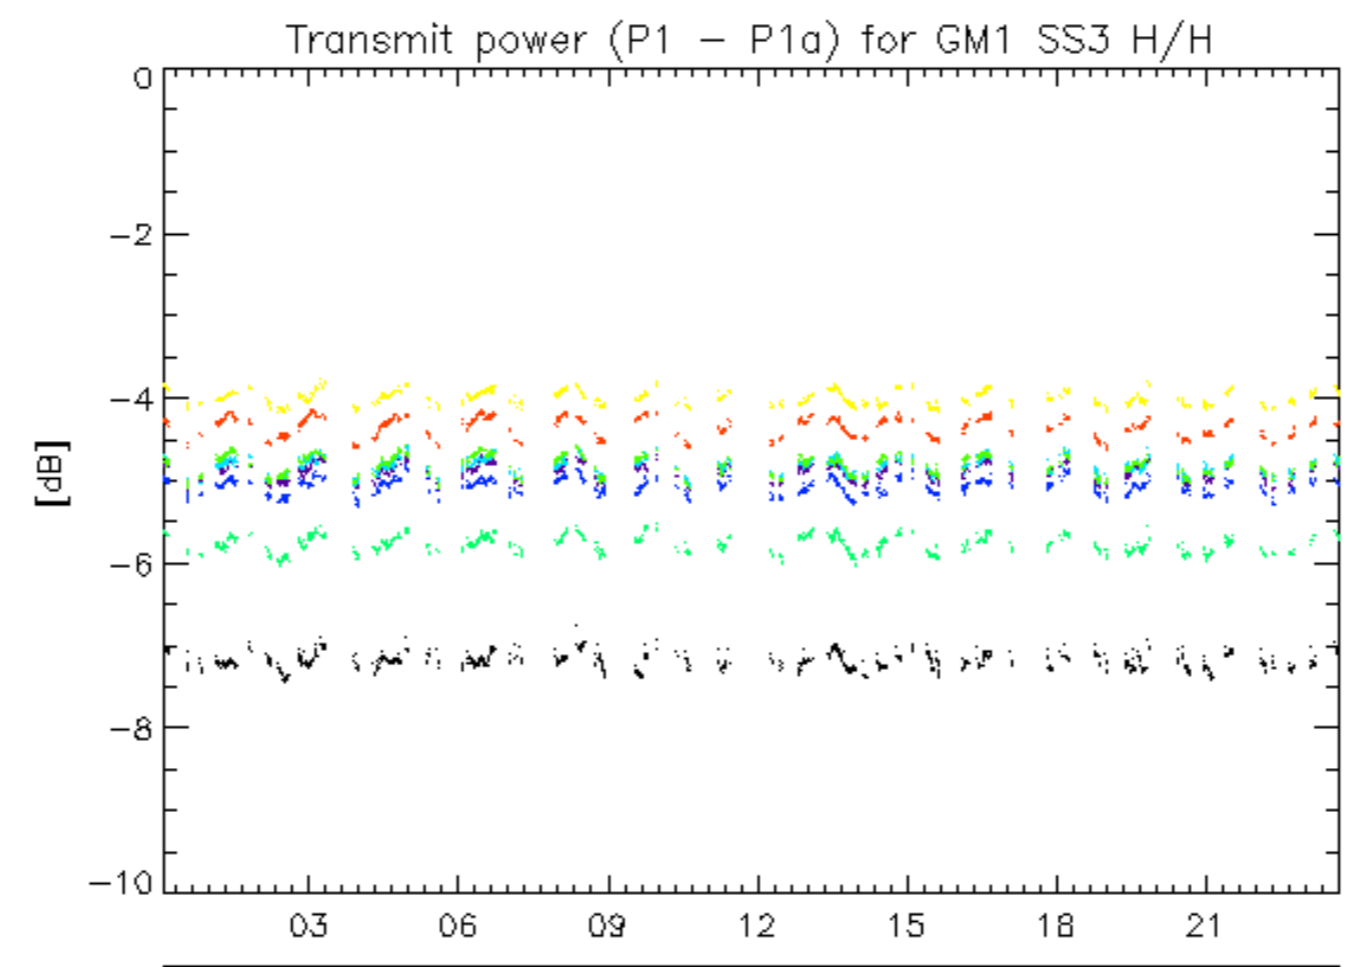




12-May  
rows: \_ 1 \_ 5 \_ 9 \_ 13 \_ 17 \_ 21 \_ 25 \_ 29

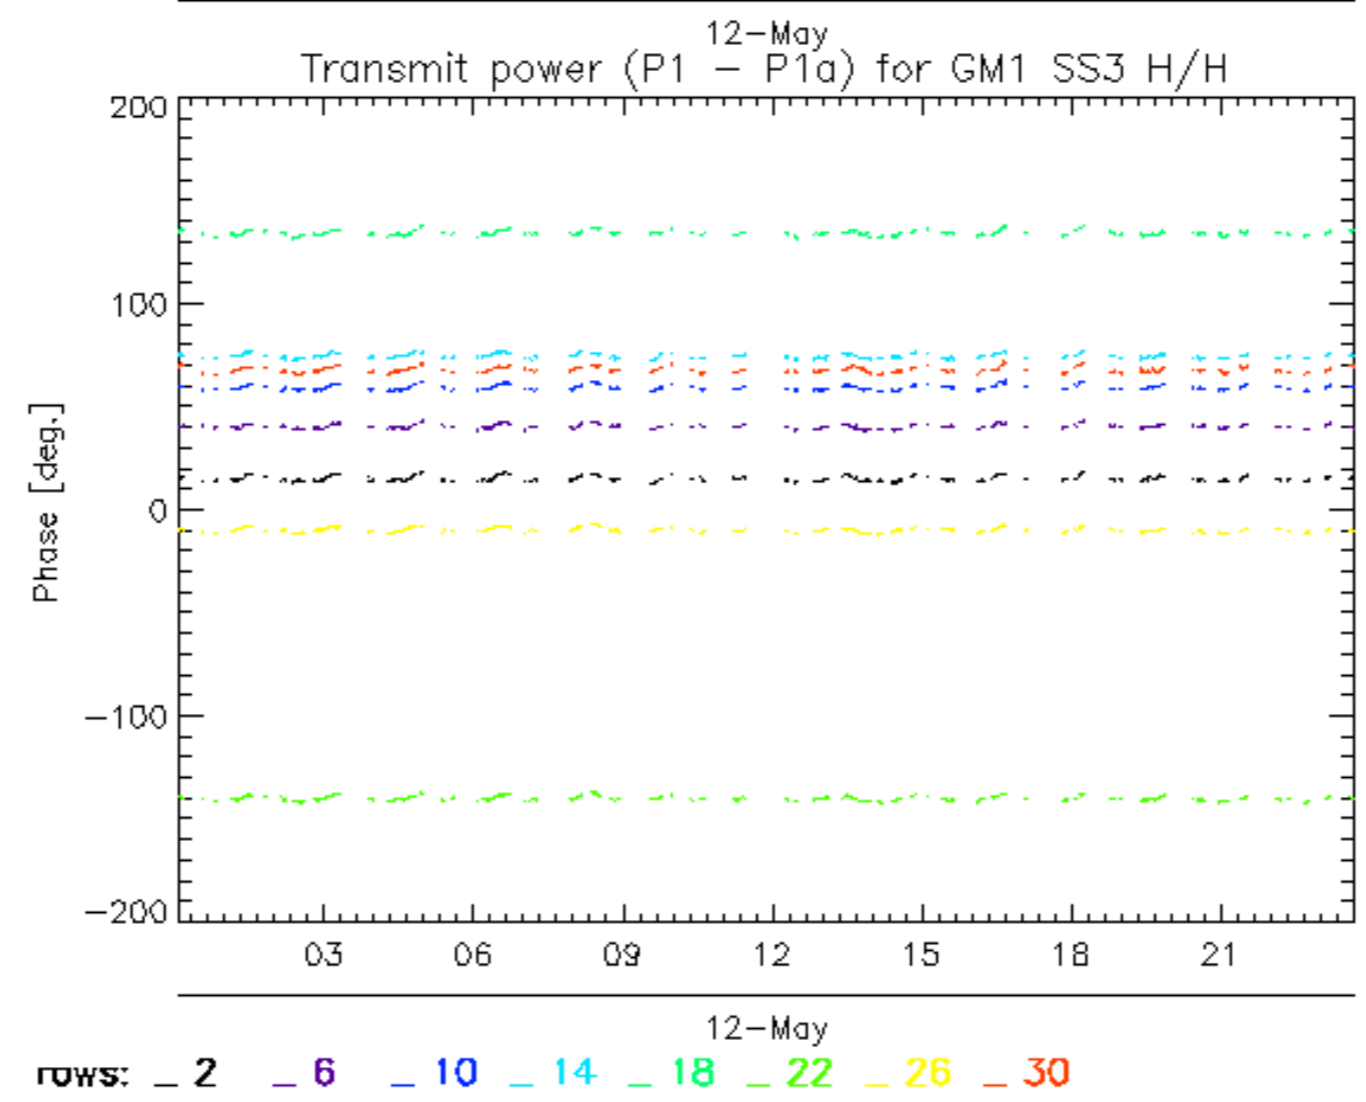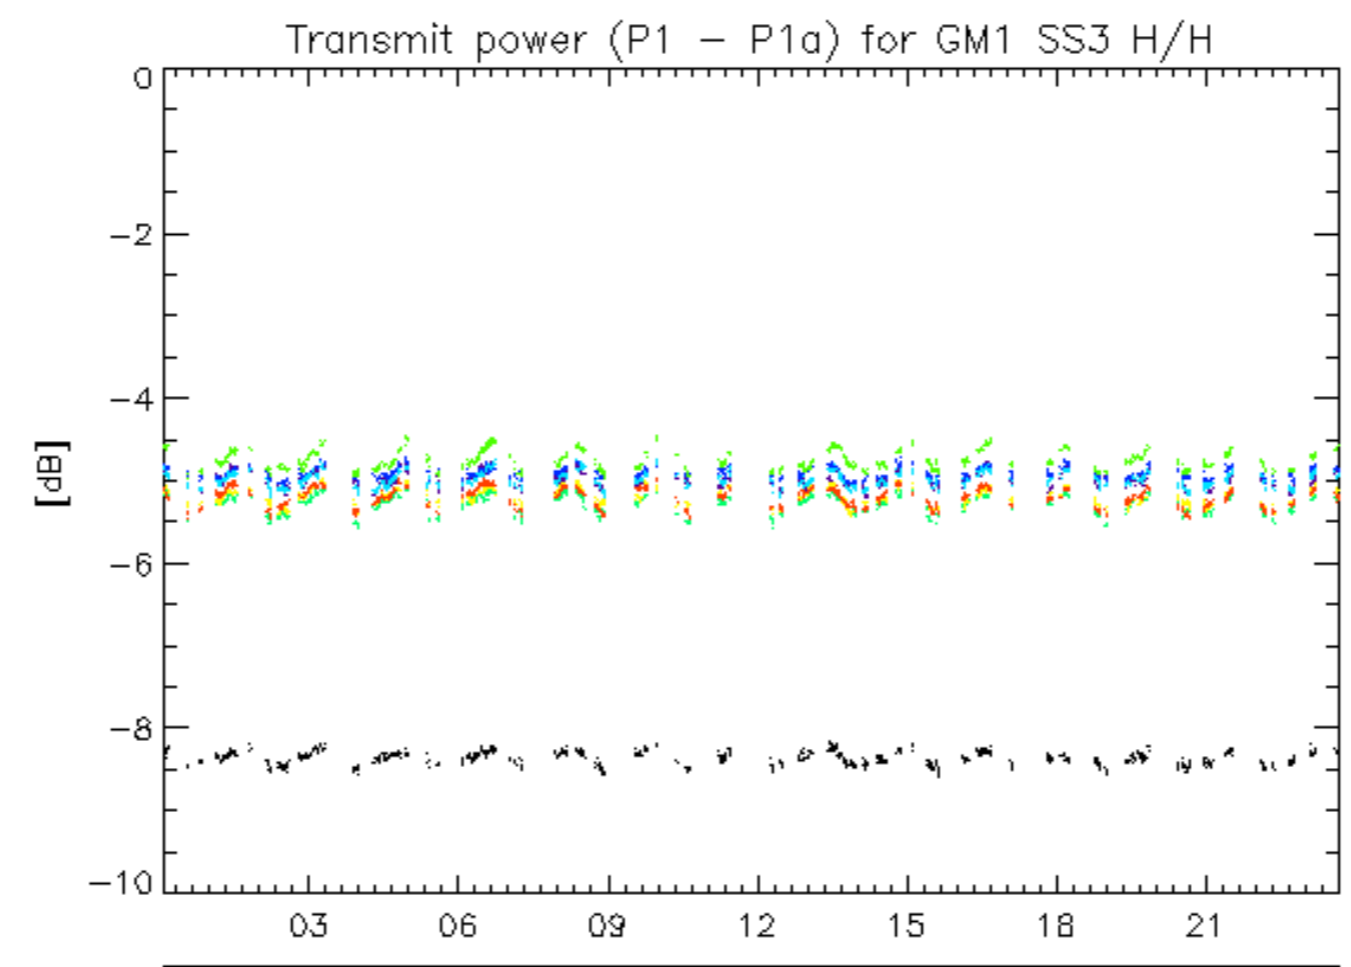

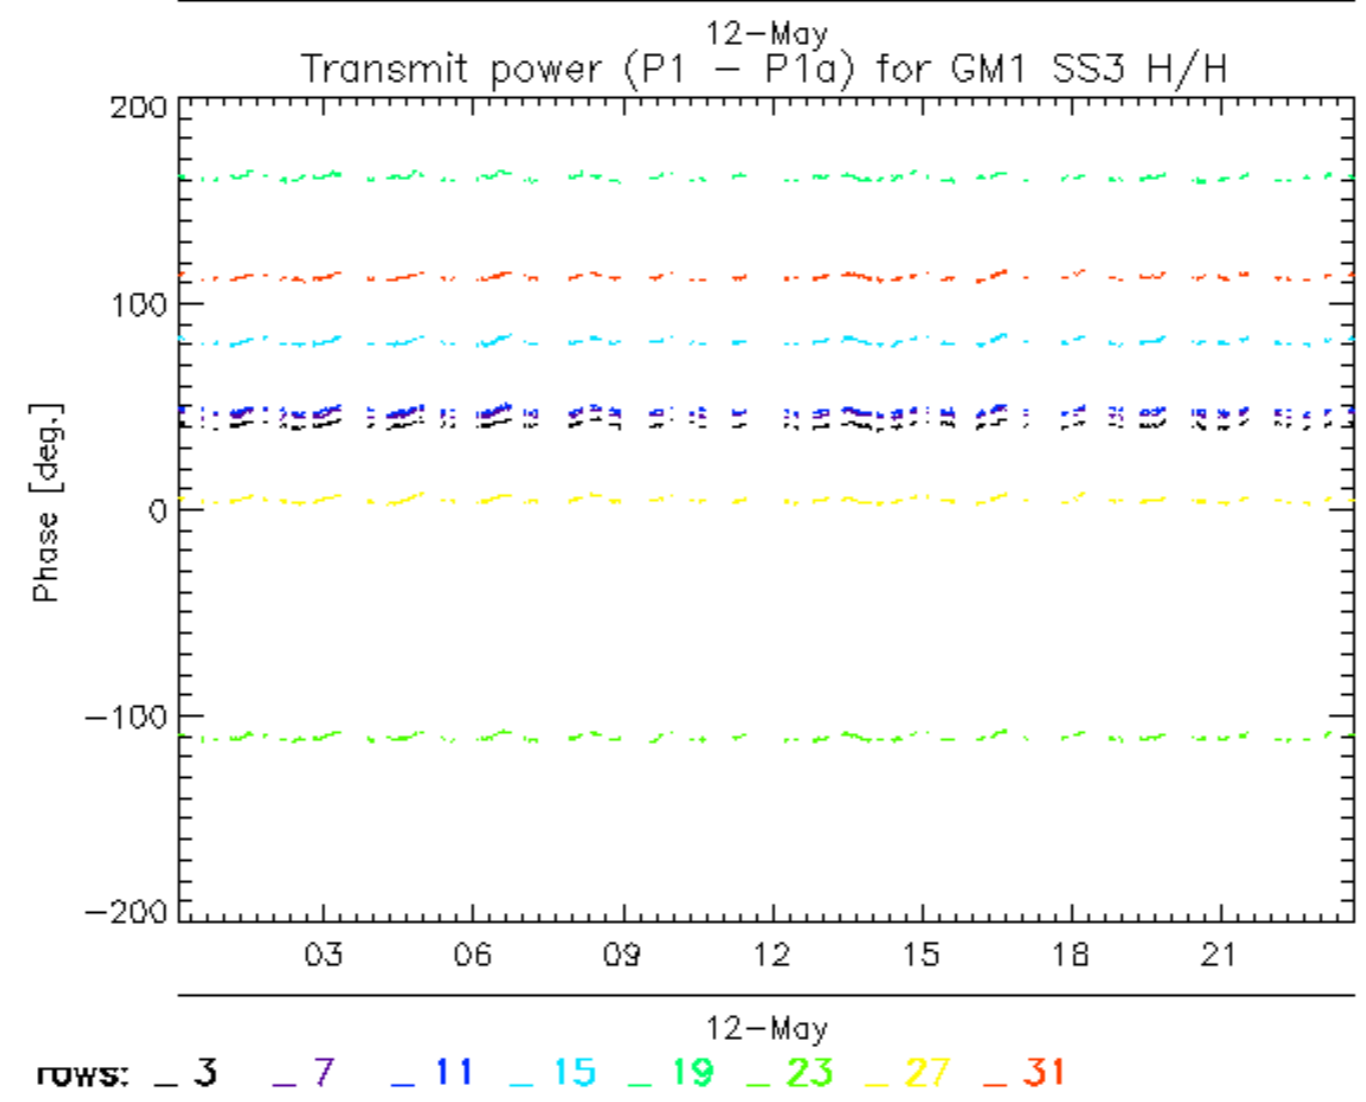
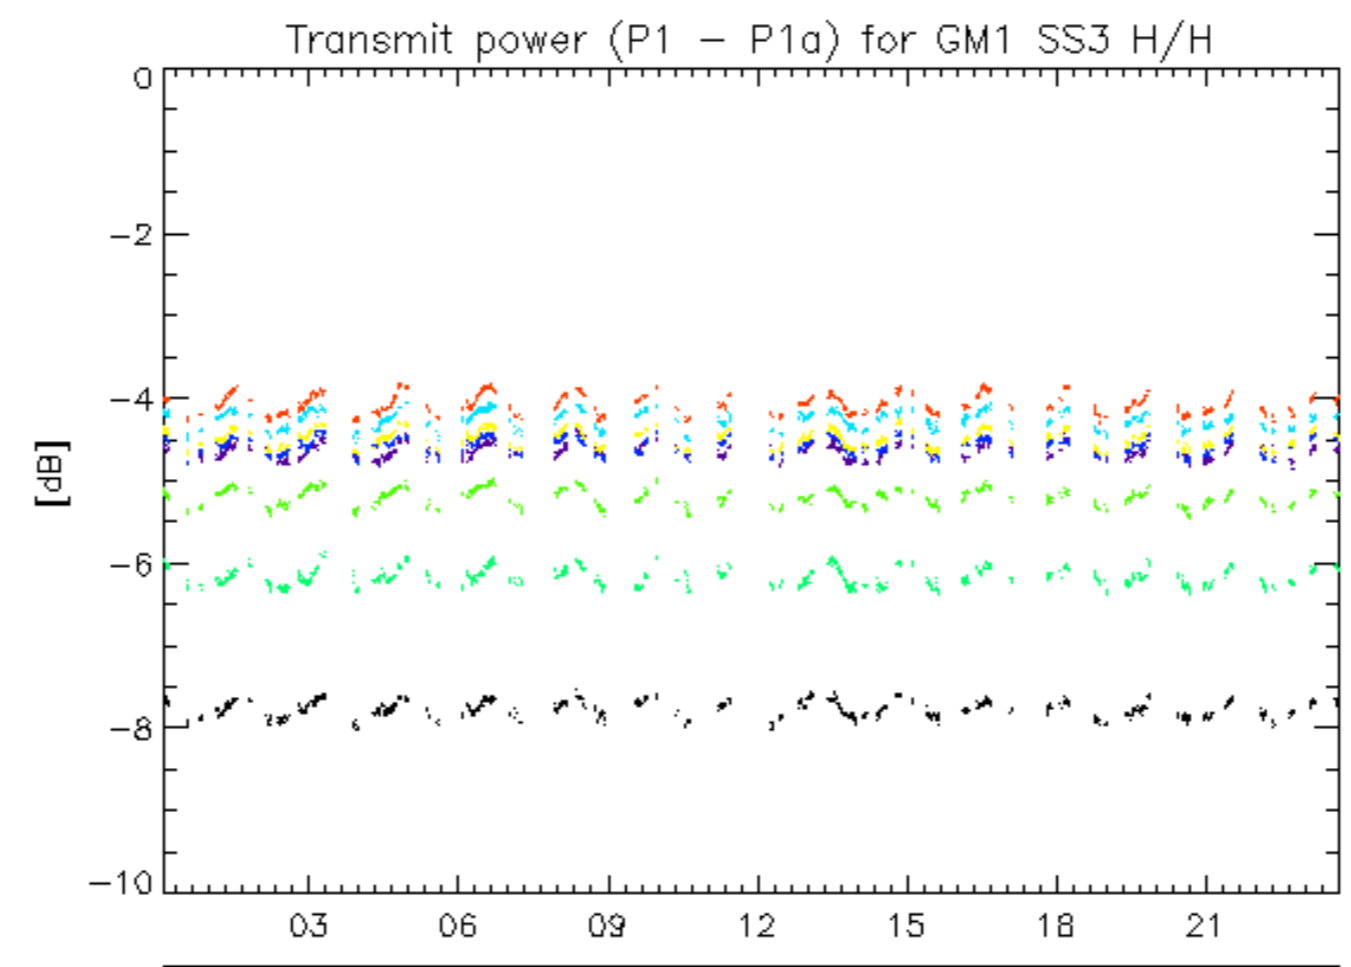


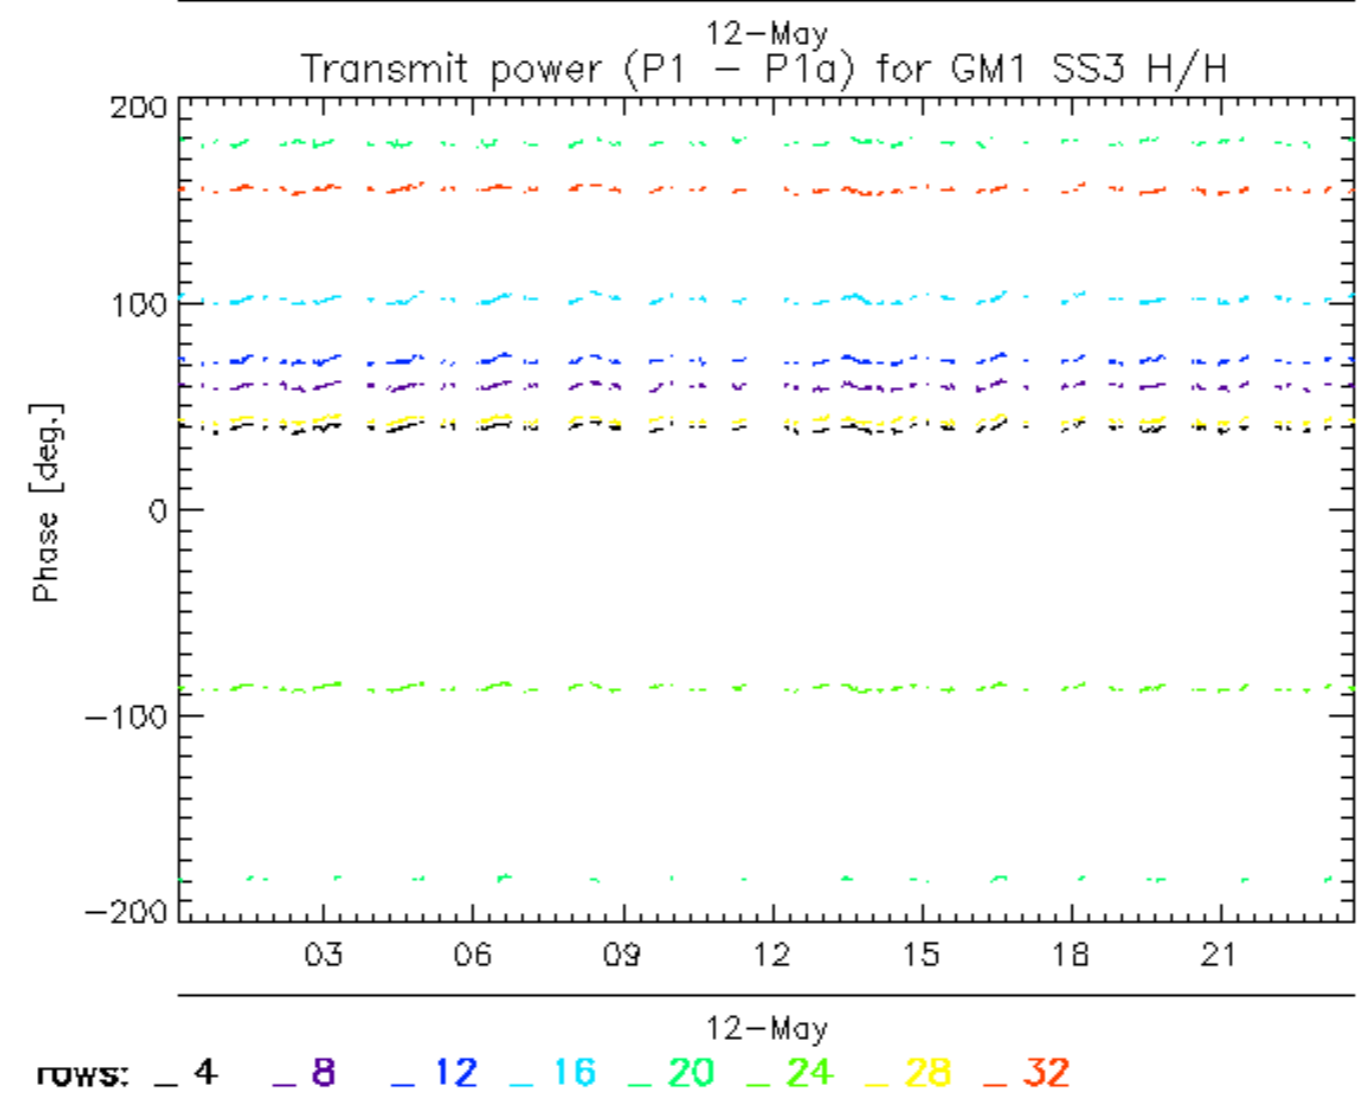
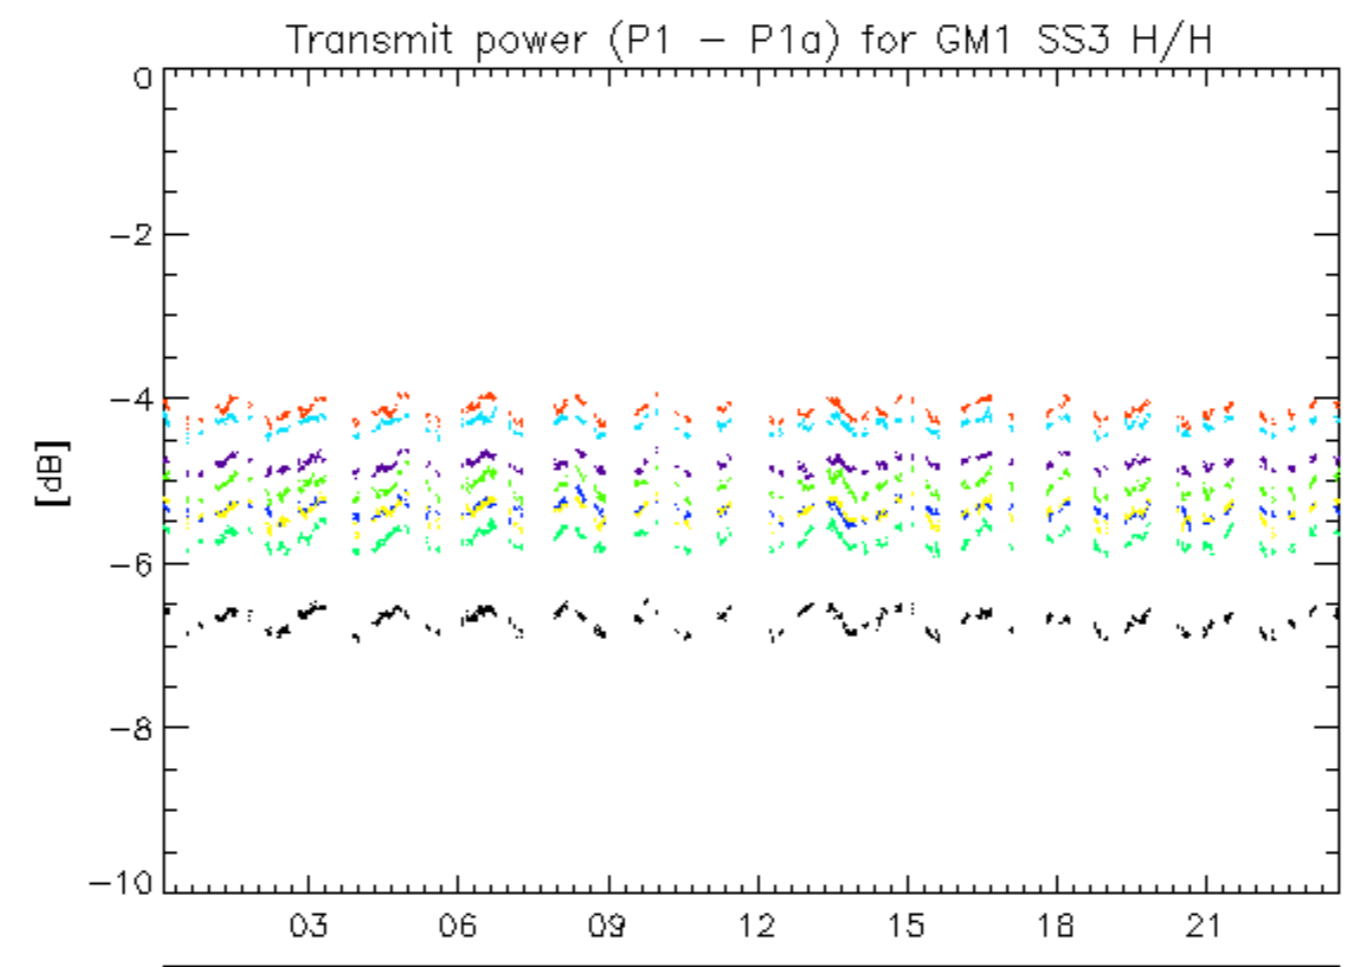


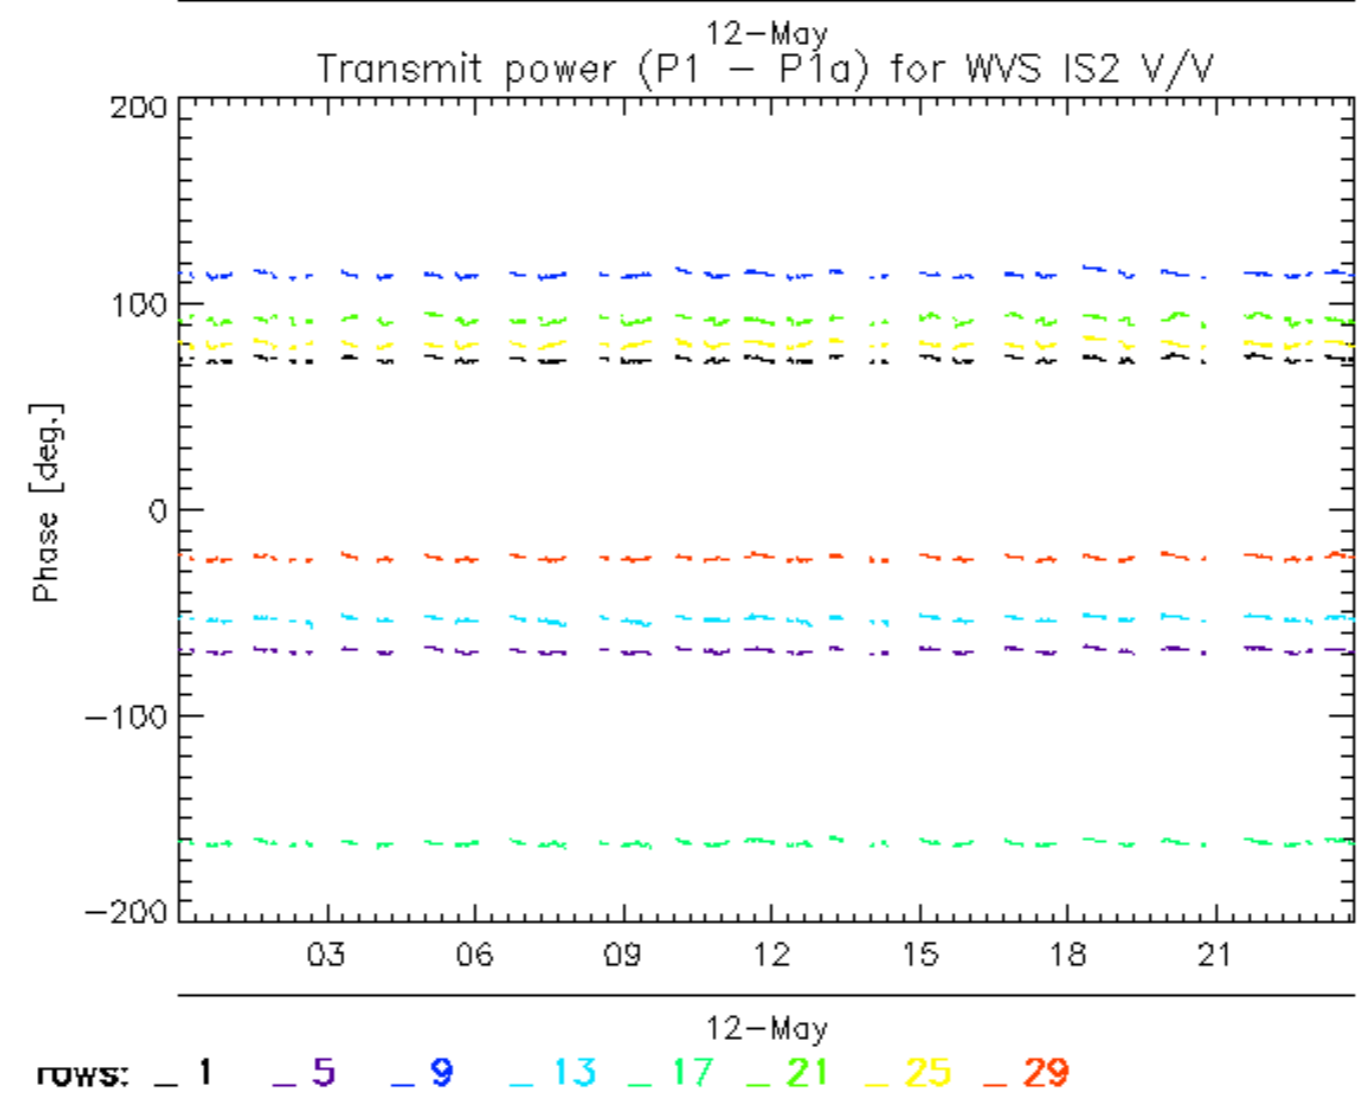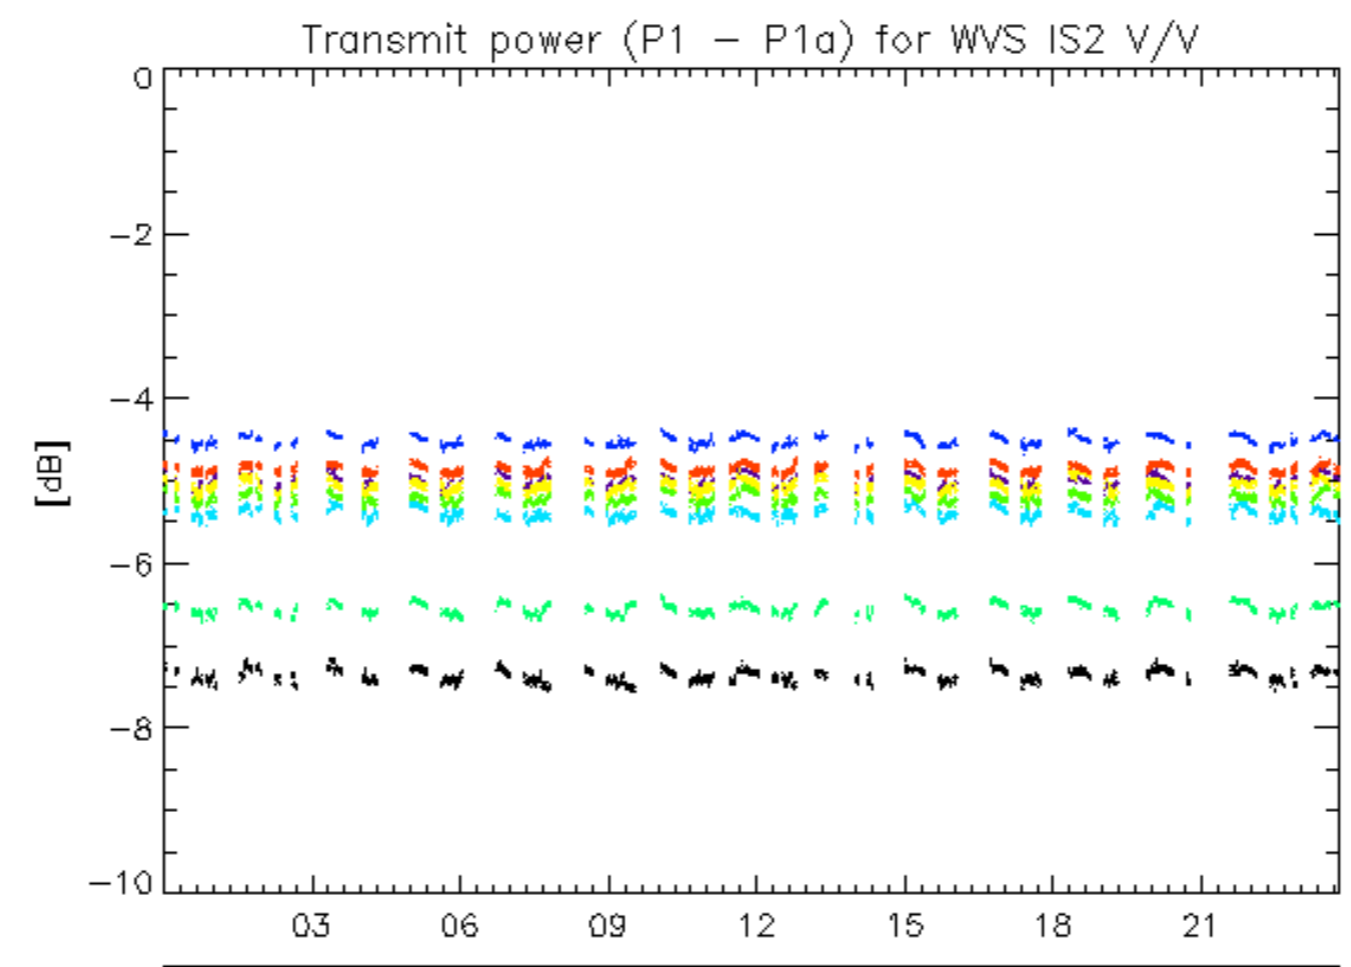

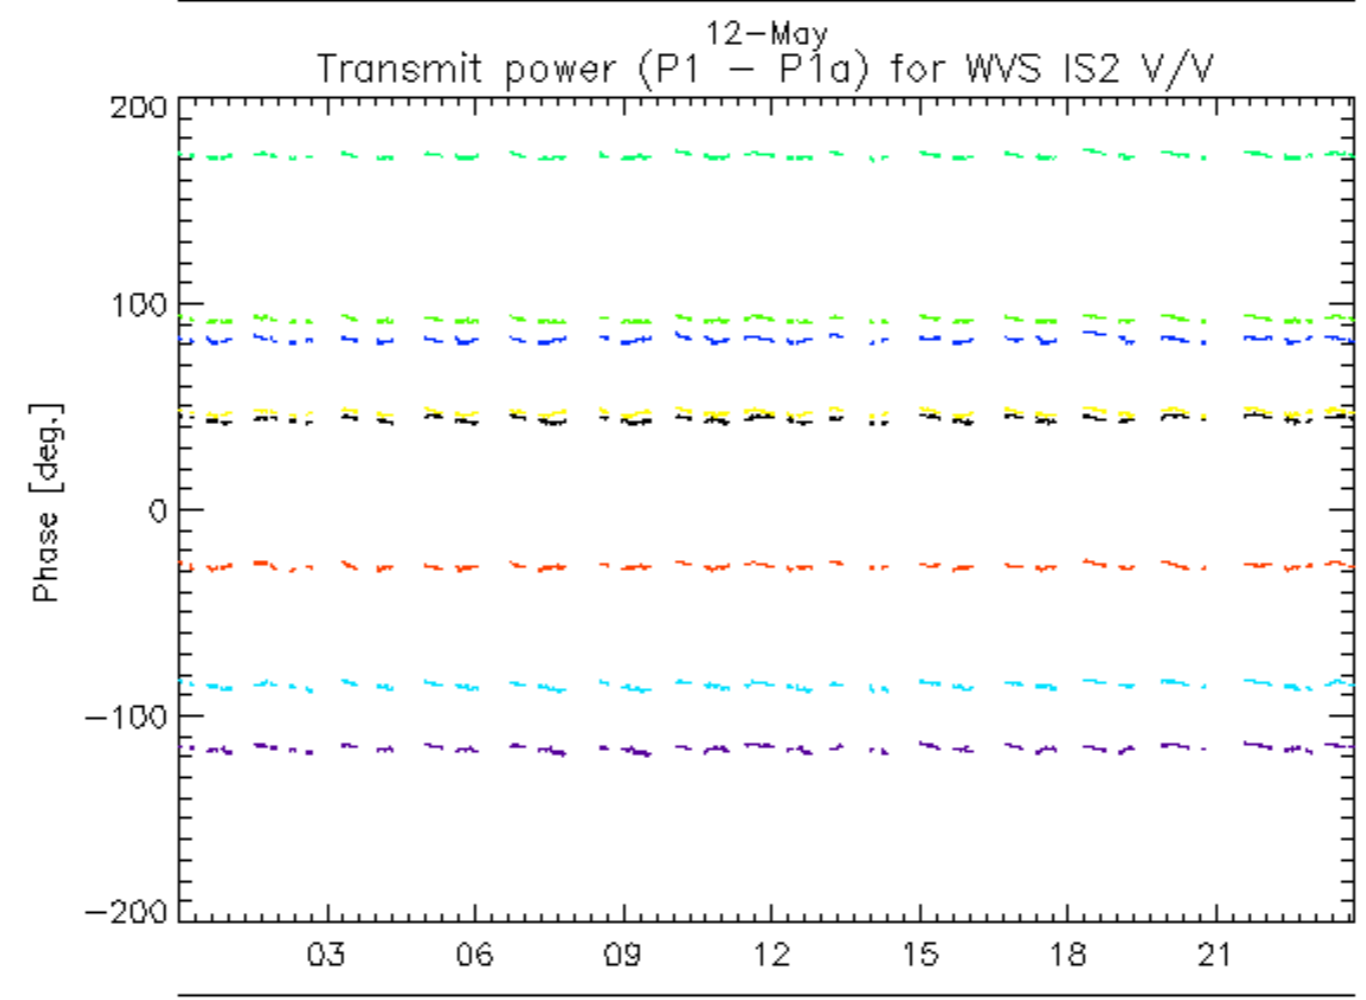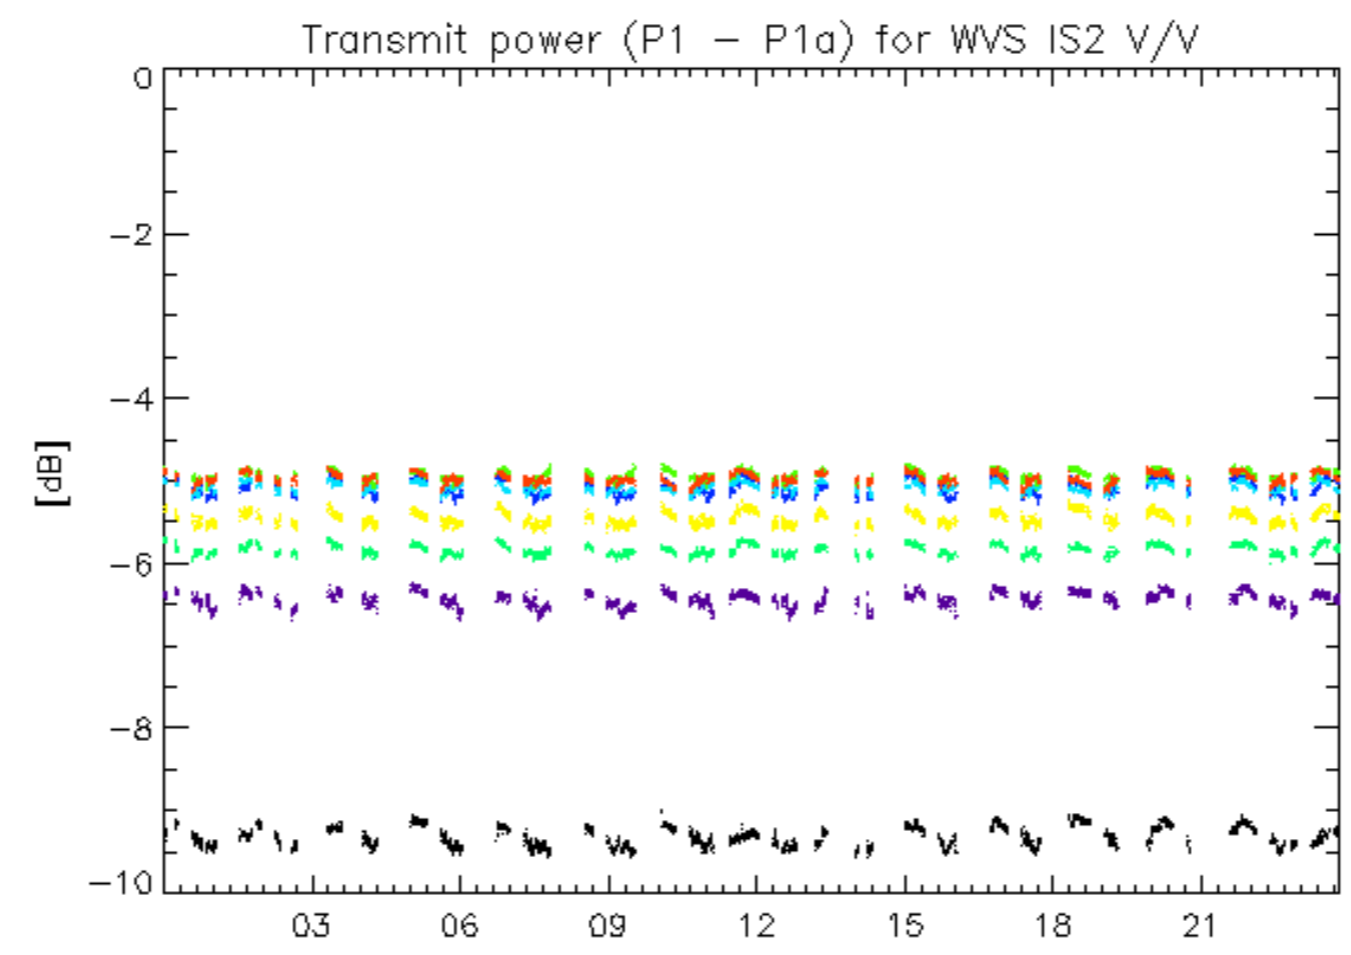



12-May  
rows: \_ 2 \_ 6 \_ 10 \_ 14 \_ 18 \_ 22 \_ 26 \_ 30

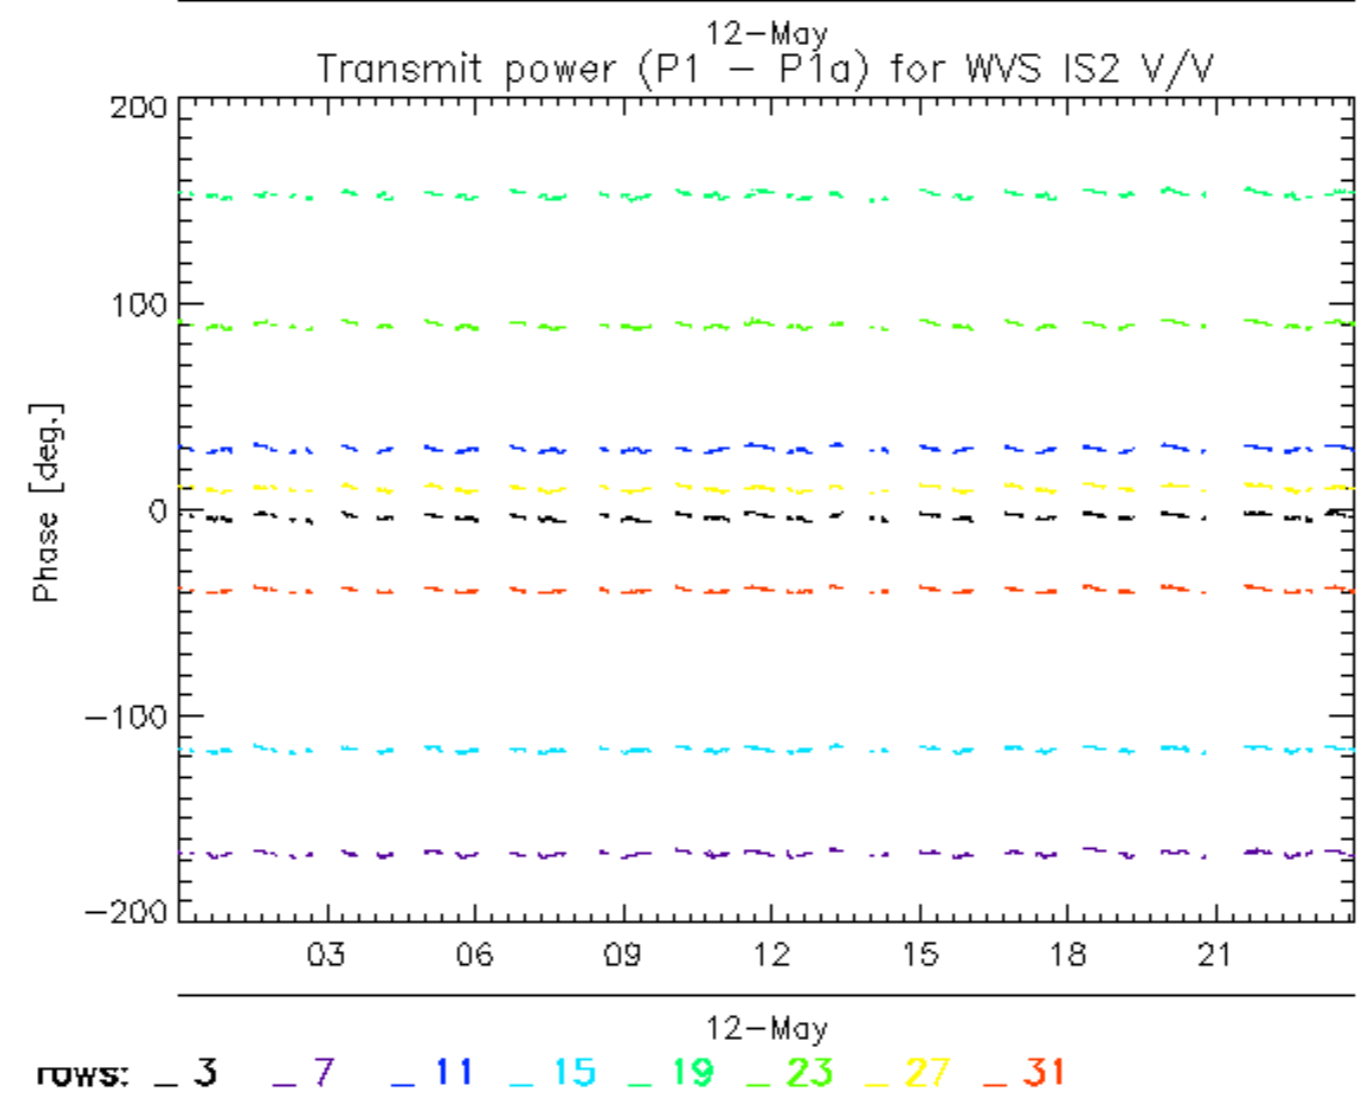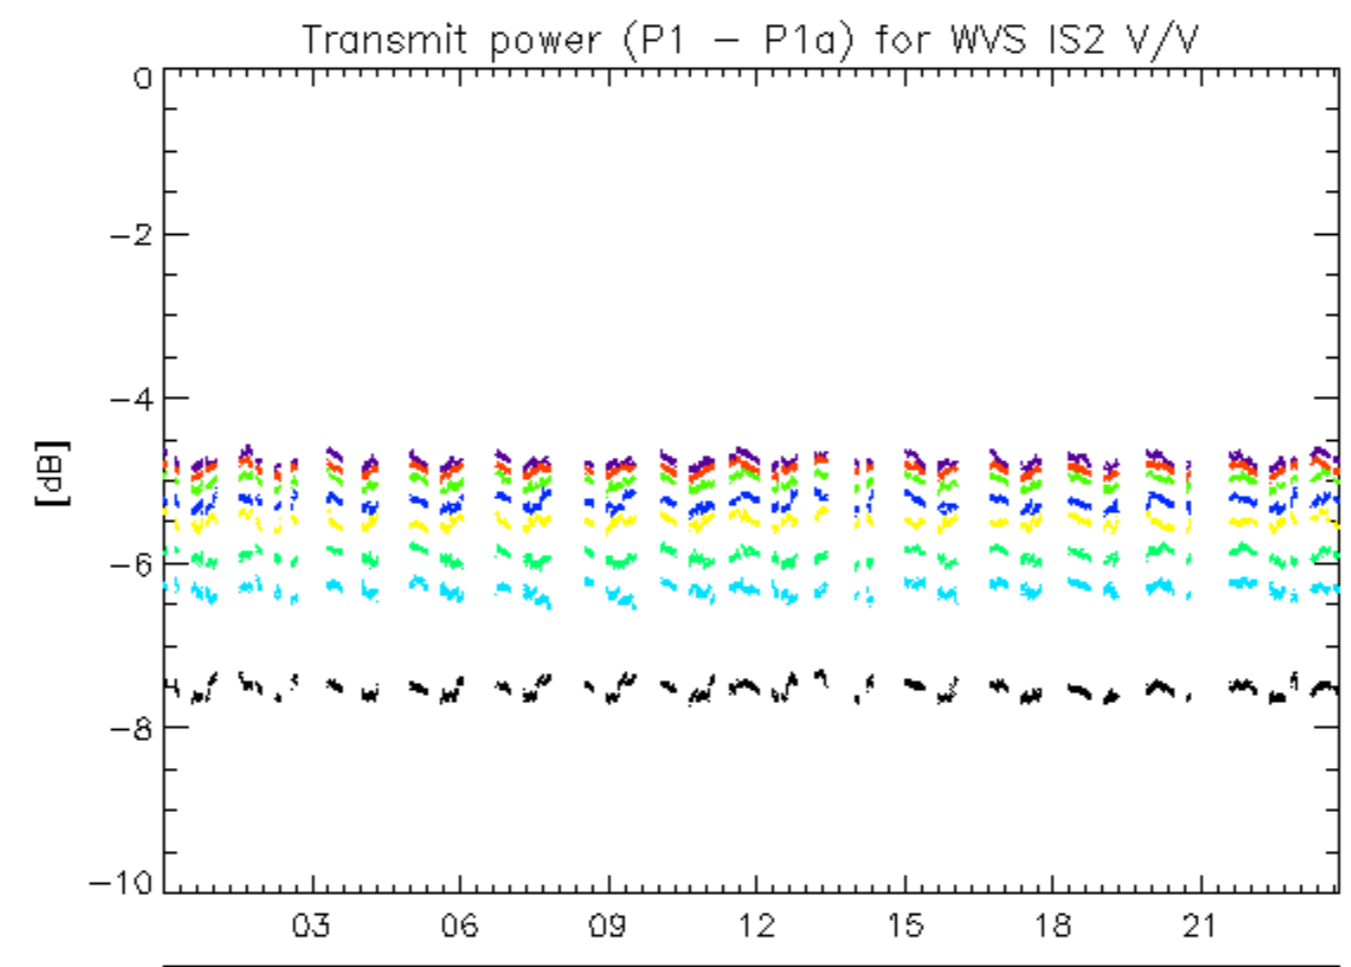


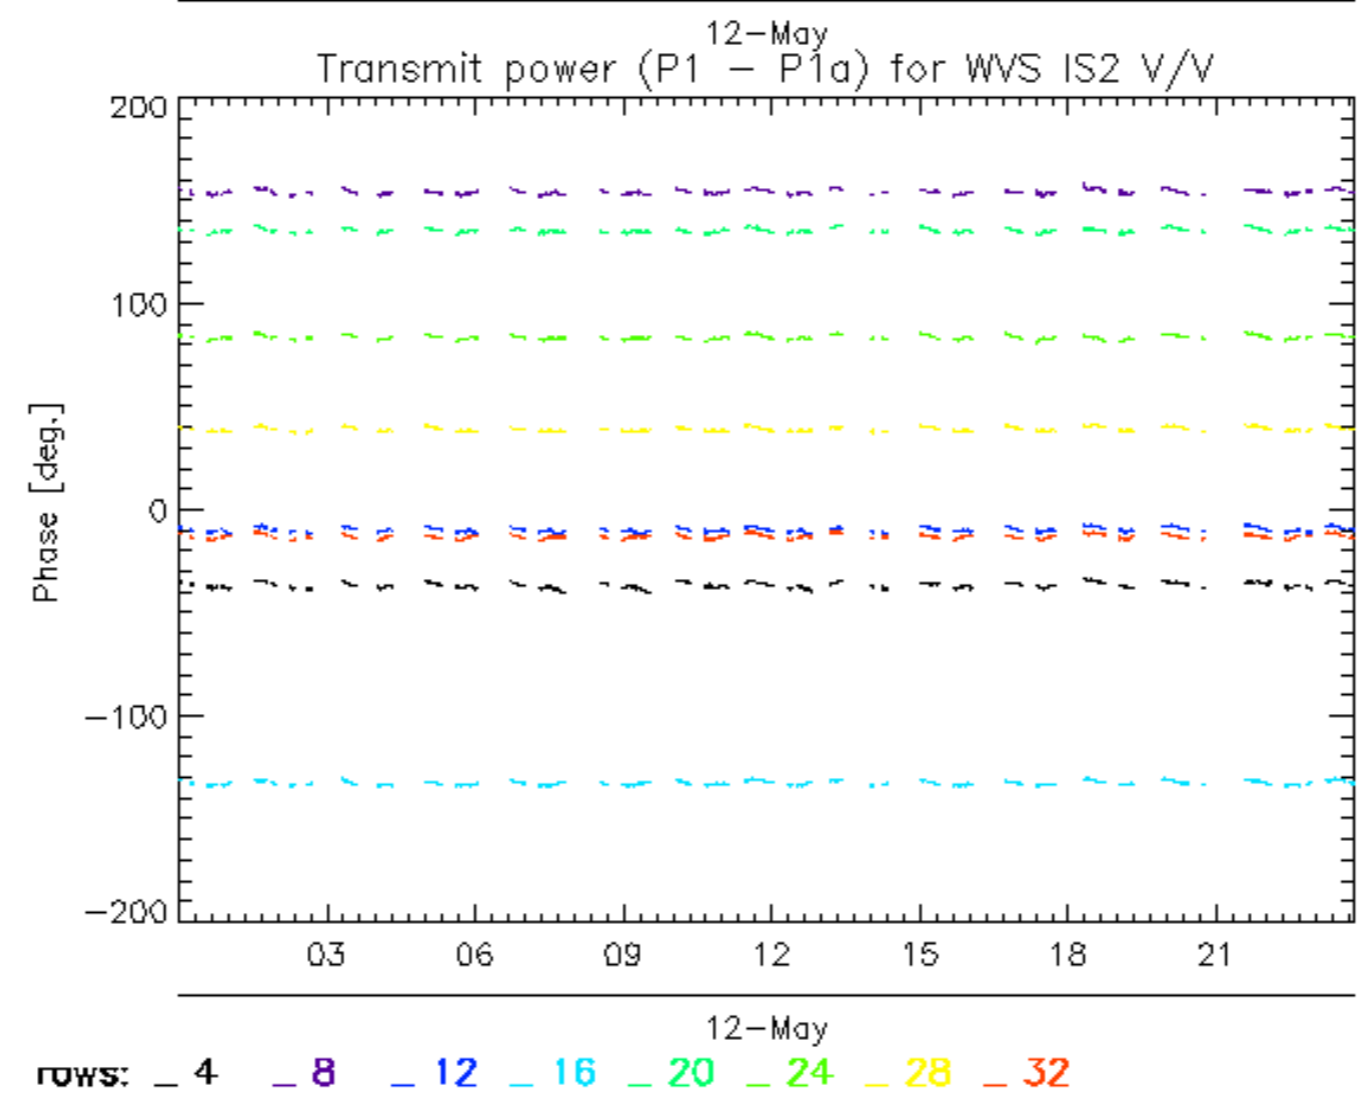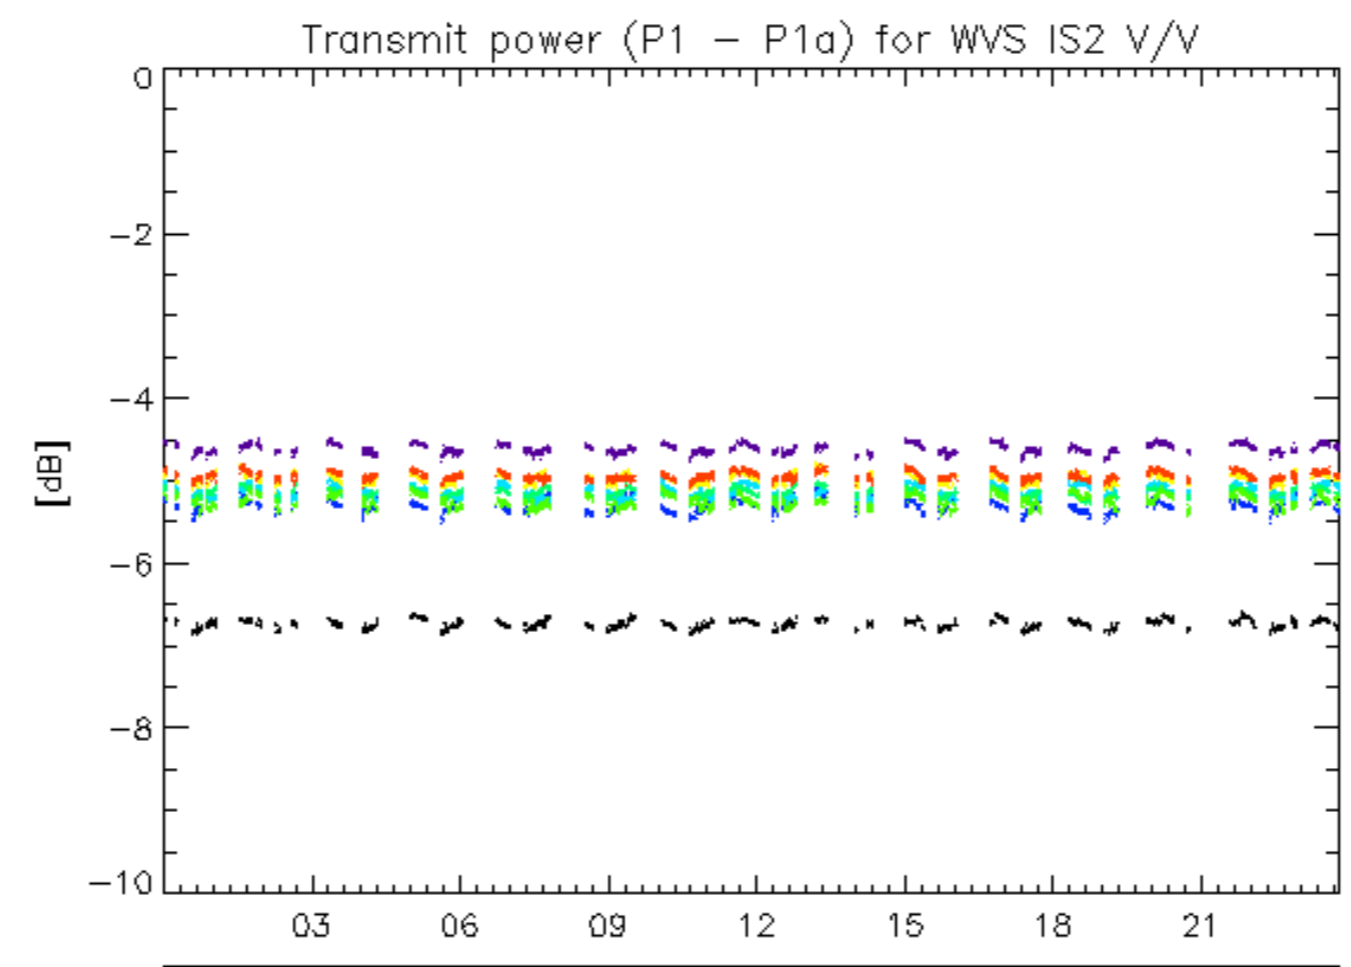




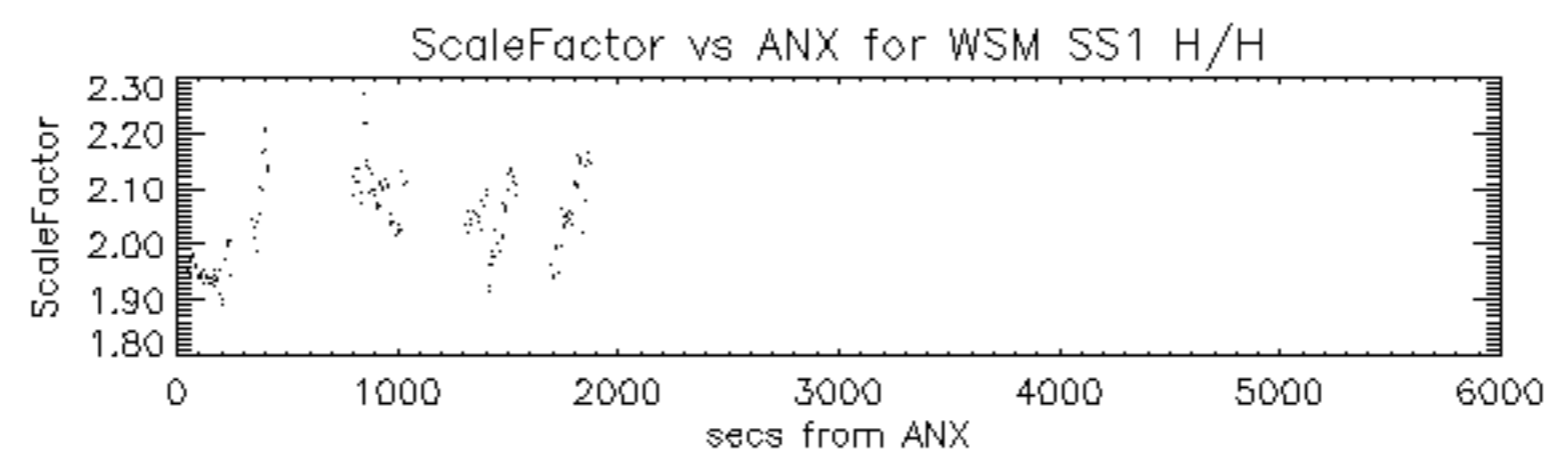

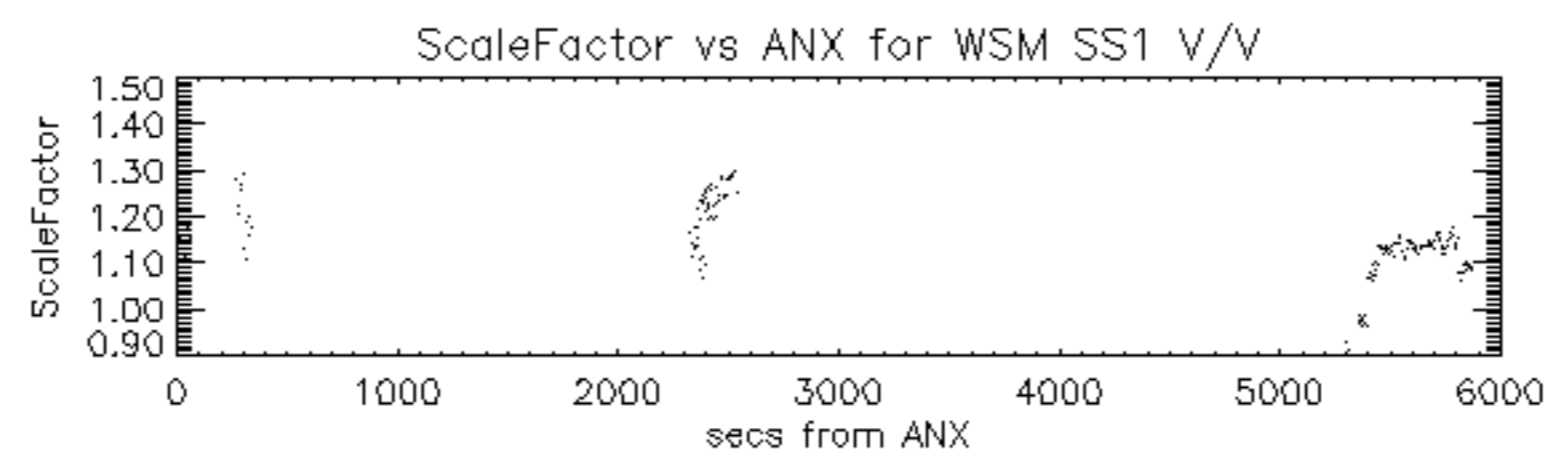

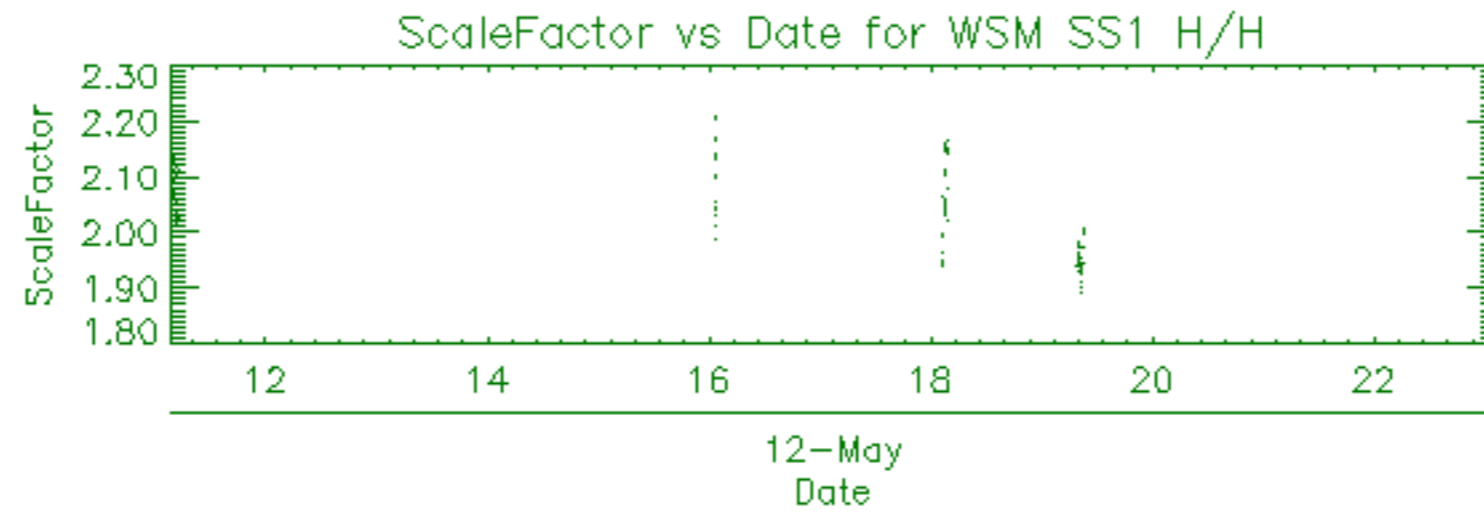

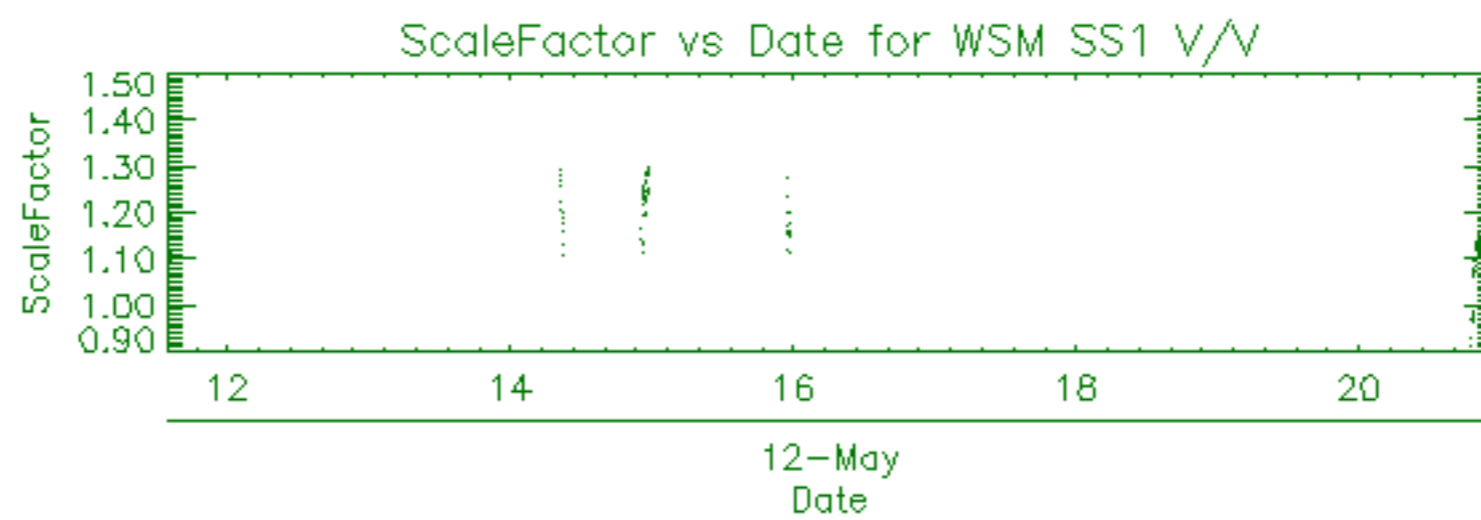

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_APM_1PNPDE20080512_010416_000001522068_00289_32407_7984.N1						IS6	H/H	68	32407	289	4.06
ASA_APM_1PNPDE20080512_030528_000000422068_00290_32408_7982.N1						IS1	V/H	68	32408	290	4.06
ASA_APM_1PNPDE20080512_032115_000000562068_00290_32408_8005.N1						IS4	V/H	68	32408	290	4.06
ASA_APM_1PNPDE20080512_042629_000000402068_00291_32409_8260.N1						IS7	H/H	68	32409	291	4.06
ASA_APM_1PNPDE20080512_044443_000000412068_00291_32409_8123.N1						IS4	H/H	68	32409	291	4.06
ASA_APM_1PNPDE20080512_044548_000000422068_00291_32409_8125.N1						IS1	H/H	68	32409	291	4.06
ASA_APM_1PNPDE20080512_061224_000000402068_00292_32410_8315.N1						IS1	H/H	68	32410	292	4.06
ASA_APM_1PNPDE20080512_082014_000001042068_00293_32411_8571.N1						IS3	H/V	68	32411	293	4.06
ASA_APM_1PNPDE20080512_082116_000000422068_00293_32411_8470.N1						IS3	H/V	68	32411	293	4.06
ASA_APM_1PNPDK20080512_125302_000000412068_00296_32414_1636.N1						IS4	H/H	68	32414	296	4.06

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_GM1_1PNPDE20080512_000455_000004102068_00288_32406_7702.N1						SS1	H/H	68	32406	288	4.06
ASA_GM1_1PNPDE20080512_003234_000001382068_00288_32406_7704.N1						SS1	H/H	68	32406	288	4.06
ASA_GM1_1PNPDE20080512_004834_000001572068_00288_32406_7861.N1						SS1	H/H	68	32406	288	4.06
ASA_GM1_1PNPDE20080512_010808_0000014742068_00289_32407_7953.N1						SS1	H/H	68	32407	289	4.06
ASA_GM1_1PNPDE20080512_014814_000001142068_00289_32407_7869.N1						SS1	H/H	68	32407	289	4.06
ASA_GM1_1PNPDE20080512_020859_000003862068_00289_32407_7871.N1						SS1	H/H	68	32407	289	4.06
ASA_GM1_1PNPDE20080512_022234_000007852068_00289_32407_7997.N1						SS1	H/H	68	32407	289	4.06
ASA_GM1_1PNPDE20080512_024636_000004042068_00290_32408_8083.N1						SS1	H/H	68	32408	290	4.06
ASA_GM1_1PNPDE20080512_025418_000006702068_00290_32408_8027.N1						SS1	H/H	68	32408	290	4.06
ASA_GM1_1PNPDE20080512_030636_000002472068_00290_32408_8023.N1						SS1	H/H	68	32408	290	4.06
ASA_GM1_1PNPDE20080512_031404_000003022068_00290_32408_8025.N1						SS1	H/H	68	32408	290	4.06
ASA_GM1_1PNPDE20080512_035344_000001382068_00290_32408_8133.N1						SS1	H/H	68	32408	290	4.06
ASA_GM1_1PNPDE20080512_035704_000002052068_00290_32408_8138.N1						SS1	H/H	68	32408	290	4.06
ASA_GM1_1PNPDE20080512_041705_000000842068_00291_32409_8140.N1						SS1	H/H	68	32409	291	4.06
ASA_GM1_1PNPDE20080512_042038_000003502068_00291_32409_8142.N1						SS1	H/H	68	32409	291	4.06
ASA_GM1_1PNPDE20080512_042737_000010262068_00291_32409_8251.N1						SS1	H/H	68	32409	291	4.06
ASA_GM1_1PNPDE20080512_044655_000001992068_00291_32409_8163.N1						SS1	H/H	68	32409	291	4.06
ASA_GM1_1PNPDE20080512_045550_000002472068_00291_32409_8186.N1						SS1	H/H	68	32409	291	4.06
ASA_GM1_1PNPDE20080512_052043_000000842068_00291_32409_8304.N1						SS1	H/H	68	32409	291	4.06
ASA_GM1_1PNPDE20080512_052444_000000842068_00291_32409_8302.N1						SS1	H/H	68	32409	291	4.06
ASA_GM1_1PNPDE20080512_053428_000001322068_00291_32409_8309.N1						SS1	H/H	68	32409	291	4.06
ASA_GM1_1PNPDE20080512_060322_000001752068_00292_32410_8313.N1						SS1	H/H	68	32410	292	4.06
ASA_GM1_1PNPDE20080512_061003_000001382068_00292_32410_8311.N1						SS1	H/H	68	32410	292	4.06
ASA_GM1_1PNPDE20080512_061332_000018242068_00292_32410_8411.N1						SS1	H/H	68	32410	292	4.06
ASA_GM1_1PNPDK20080512_070119_000001322068_00292_32410_1141.N1						SS1	H/H	68	32410	292	4.06
ASA_GM1_1PNPDK20080512_070807_000000842068_00292_32410_1139.N1						SS1	H/H	68	32410	292	4.06
ASA_GM1_1PNPDK20080512_071417_000001812068_00292_32410_1152.N1						SS1	H/H	68	32410	292	4.06
ASA_GM1_1PNPDK20080512_075609_000003982068_00293_32411_1160.N1						SS1	H/H	68	32411	293	4.06
ASA_GM1_1PNPDK20080512_080210_000005672068_00293_32411_1227.N1						SS1	H/H	68	32411	293	4.06
ASA_GM1_1PNPDK20080512_082224_000006042068_00293_32411_1231.N1						SS1	H/H	68	32411	293	4.06
ASA_GM1_1PNPDK20080512_084311_000001022068_00293_32411_1229.N1						SS1	H/H	68	32411	293	4.06
ASA_GM1_1PNPDK20080512_084734_000006162068_00293_32411_1245.N1						SS1	H/H	68	32411	293	4.06
ASA_GM1_1PNPDK20080512_093235_000005192068_00294_32412_1252.N1						SS1	H/H	68	32412	294	4.06
ASA_GM1_1PNPDK20080512_094357_000000782068_00294_32412_1314.N1						SS1	H/H	68	32412	294	4.06
ASA_GM1_1PNPDK20080512_094434_000001872068_00294_32412_1377.N1						SS1	H/H	68	32412	294	4.06
ASA_GM1_1PNPDK20080512_095737_000001082068_00294_32412_1391.N1						SS1	H/H	68	32412	294	4.06
ASA_GM1_1PNPDK20080512_102231_000000782068_00294_32412_1389.N1						SS1	H/H	68	32412	294	4.06
ASA_GM1_1PNPDK20080512_103328_000003022068_00294_32412_1399.N1						SS1	H/H	68	32412	294	4.06
ASA_GM1_1PNPDK20080512_111313_000005732068_00295_32413_1425.N1						SS1	H/H	68	32413	295	4.06
ASA_GM1_1PNPDK20080512_112533_000001382068_00295_32413_1508.N1						SS1	H/H	68	32413	295	4.06
ASA_GM1_1PNPDK20080512_121621_000001632068_00295_32413_1513.N1						SS1	H/H	68	32413	295	4.06
ASA_GM1_1PNPDK20080512_122639_000002352068_00295_32413_1521.N1						SS1	H/H	68	32413	295	4.06
ASA_GM1_1PNPDK20080512_124825_000002772068_00296_32414_1523.N1						SS1	H/H	68	32414	296	4.06
ASA_GM1_1PNPDK20080512_125410_000005312068_00296_32414_1582.N1						SS1	H/H	68	32414	296	4.06
ASA_GM1_1PNPDK20080512_130223_000002592068_00296_32414_1659.N1						SS1	H/H	68	32414	296	4.06
ASA_GM1_1PNPDK20080512_132507_000006462068_00296_32414_1661.N1						SS1	H/H	68	32414	296	4.06
ASA_GM1_1PNPDK20080512_133606_000003622068_00296_32414_1663.N1						SS1	H/H	68	32414	296	4.06
ASA_GM1_1PNPDK20080512_134342_000009242068_00296_32414_1673.N1						SS1	H/H	68	32414	296	4.06
ASA_GM1_1PNPDK20080512_140732_000002772068_00296_32414_1671.N1						SS1	H/H	68	32414	296	4.06
ASA_GM1_1PNPDK20080512_142412_000007732068_00297_32415_1752.N1						SS1	H/H	68	32415	297	4.06
ASA_GM1_1PNPDK20080512_144729_000003982068_00297_32415_1783.N1						SS1	H/H	68	32415	297	4.06
ASA_GM1_1PNPDK20080512_150633_000001502068_00297_32415_1788.N1						SS1	H/H	68	32415	297	4.06
ASA_GM1_1PNPDK20080512_152418_000004772068_00297_32415_1790.N1						SS1	H/H	68	32415	297	4.06
ASA_GM1_1PNPDK20080512_153428_000003442068_00297_32415_1798.N1						SS1	H/H	68	32415	297	4.06
ASA_GM1_1PNPDK20080512_160655_000004712068_00298_32416_1803.N1						SS1	H/H	68	32416	298	4.06
ASA_GM1_1PNPDK20080512_162443_000010992068_00298_32416_1991.N1						SS1	H/H	68	32416	298	4.06
ASA_GM1_1PNPDK20080512_170454_000002052068_00298_32416_1910.N1						SS1	H/H	68	32416	298	4.06
ASA_GM1_1PNPDK20080512_174806_000003982068_00299_32417_1919.N1						SS1	H/H	68	32417	299	4.06
ASA_GM1_1PNPDK20080512_180451_000000782068_00299_32417_2028.N1						SS1	H/H	68	32417	299	4.06
ASA_GM1_1PNPDK20080512_180941_000003802068_00299_32417_2030.N1						SS1	H/H	68	32417	299	4.06
ASA_GM1_1PNPDK20080512_184530_000004832068_00299_32417_2032.N1						SS1	H/H	68	32417	299	4.06
ASA_GM1_1PNPDK20080512_185901_000001442068_00299_32417_2034.N1						SS1	H/H	68	32417	299	4.06
ASA_GM1_1PNPDK20080512_192305_000003922068_00300_32418_2042.N1						SS1	H/H	68	32418	300	4.06
ASA_GM1_1PNPDK20080512_193111_000002172068_00300_32418_2049.N1						SS1	H/H	68	32418	300	4.06
ASA_GM1_1PNPDE20080512_193347_000000662068_00300_32418_8701.N1						SS1	H/H	68	32418	300	4.06
ASA_GM1_1PNPDE20080512_193851_000005922068_00300_32418_8703.N1						SS1	H/H	68	32418	300	4.06
ASA_GM1_1PNPDE20080512_195025_000001142068_00300_32418_8705.N1						SS1	H/H	68	32418	300	4.06

ASA_GM1_1PNPDE20080512_202606_000001442068_00300_32418_8707.N1	SS1	H/H	68	32418	300	4.06
ASA_GM1_1PNPDE20080512_203118_000006462068_00300_32418_8740.N1	SS1	H/H	68	32418	300	4.06
ASA_GM1_1PNPDE20080512_205645_000007182068_00300_32418_8863.N1	SS1	H/H	68	32418	300	4.06
ASA_GM1_1PNPDE20080512_212350_000005372068_00301_32419_8998.N1	SS1	H/H	68	32419	301	4.06
ASA_GM1_1PNPDE20080512_220642_000004412068_00301_32419_8881.N1	SS1	H/H	68	32419	301	4.06
ASA_GM1_1PNPDE20080512_222026_000001322068_00301_32419_8888.N1	SS1	H/H	68	32419	301	4.06
ASA_GM1_1PNPDE20080512_224053_000003862068_00302_32420_9003.N1	SS1	H/H	68	32420	302	4.06
ASA_GM1_1PNPDE20080512_230554_000004472068_00302_32420_9012.N1	SS1	H/H	68	32420	302	4.06
ASA_GM1_1PNPDE20080512_233556_000002172068_00302_32420_9010.N1	SS1	H/H	68	32420	302	4.06
ASA_GM1_1PNPDE20080512_233942_00000962068_00302_32420_9014.N1	SS1	H/H	68	32420	302	4.06


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20080512_001204_000000792068_00288_32406_7827.N1						IS6	H/H	68	32406	288	4.06
ASA_IMM_1PNPDE20080512_001946_000003012068_00288_32406_7832.N1						IS2	H/H	68	32406	288	4.06
ASA_IMM_1PNPDE20080512_001946_000003802068_00288_32406_7846.N1						IS2	H/H	68	32406	288	4.06
ASA_IMM_1PNPDE20080512_002548_000000182068_00288_32406_7811.N1						IS2	***	68	32406	288	4.06
ASA_IMM_1PNPDE20080512_002646_000003312068_00288_32406_7844.N1						IS2	H/H	68	32406	288	4.06
ASA_IMM_1PNPDE20080512_015009_000000502068_00289_32407_7955.N1						IS6	H/H	68	32407	289	4.06
ASA_IMM_1PNPDE20080512_015109_000001092068_00289_32407_7951.N1						IS6	H/H	68	32407	289	4.06
ASA_IMM_1PNPDE20080512_020046_000004742068_00289_32407_7986.N1						IS2	H/H	68	32407	289	4.06
ASA_IMM_1PNPDE20080512_024251_000002082068_00290_32408_8102.N1						IS2	V/V	68	32408	290	4.06
ASA_IMM_1PNPDE20080512_025323_000000372068_00290_32408_8092.N1						IS2	H/H	68	32408	290	4.06
ASA_IMM_1PNPDE20080512_031042_000001812068_00290_32408_8018.N1						IS2	V/V	68	32408	290	4.06
ASA_IMM_1PNPDE20080512_034106_000003212068_00290_32408_8117.N1						IS2	H/H	68	32408	290	4.06
ASA_IMM_1PNPDE20080512_034706_000003812068_00290_32408_8289.N1						IS2	H/H	68	32408	290	4.06
ASA_IMM_1PNPDE20080512_045014_000001312068_00291_32409_8249.N1						IS2	V/V	68	32409	291	4.06
ASA_IMM_1PNPDE20080512_045239_000001742068_00291_32409_8268.N1						IS2	V/V	68	32409	291	4.06
ASA_IMM_1PNPDE20080512_052207_000001402068_00291_32409_8270.N1						IS2	H/H	68	32409	291	4.06
ASA_IMM_1PNPDE20080512_052607_000004802068_00291_32409_8445.N1						IS2	H/H	68	32409	291	4.06
ASA_IMM_1PNPDE20080512_060618_000000662068_00292_32410_8409.N1						IS4	V/V	68	32410	292	4.06
ASA_IMM_1PNPDE20080512_060825_000000812068_00292_32410_8353.N1						IS2	V/V	68	32410	292	4.06
ASA_IMM_1PNPDE20080512_070329_000002612068_00292_32410_8453.N1						IS2	H/H	68	32410	292	4.06
ASA_IMM_1PNPDK20080512_070930_000002712068_00292_32410_1193.N1						IS2	H/H	68	32410	292	4.06
ASA_IMM_1PNPDK20080512_074940_000001632068_00293_32411_1207.N1						IS2	V/V	68	32411	293	4.06
ASA_IMM_1PNPDK20080512_075239_000000392068_00293_32411_1195.N1						IS2	V/V	68	32411	293	4.06
ASA_IMM_1PNPDK20080512_084456_000001402068_00293_32411_1355.N1						IS2	H/H	68	32411	293	4.06
ASA_IMM_1PNPDK20080512_094112_000000812068_00294_32412_1312.N1						IS2	H/H	68	32412	294	4.06
ASA_IMM_1PNPDK20080512_094304_000000362068_00294_32412_1241.N1						IS3	H/H	68	32412	294	4.06
ASA_IMM_1PNPDK20080512_094739_000000372068_00294_32412_1346.N1						IS7	V/V	68	32412	294	4.06
ASA_IMM_1PNPDK20080512_095131_000000822068_00294_32412_1370.N1						IS2	V/V	68	32412	294	4.06
ASA_IMM_1PNPDE20080512_095214_000000372068_00294_32412_8481.N1						IS2	V/V	68	32412	294	4.06
ASA_IMM_1PNPDE20080512_095926_000002402068_00294_32412_8494.N1						IS2	V/V	68	32412	294	4.06
ASA_IMM_1PNPDE20080512_095926_000003012068_00294_32412_8527.N1						IS2	V/V	68	32412	294	4.06
ASA_IMM_1PNPDE20080512_102350_000004412068_00294_32412_8515.N1						IS2	H/H	68	32412	294	4.06
ASA_IMM_1PNPDE20080512_103045_000001452068_00294_32412_8543.N1						IS2	H/H	68	32412	294	4.06
ASA_IMM_1PNPDE20080512_104414_000000512068_00294_32412_8537.N1						IS2	V/V	68	32412	294	4.06
ASA_IMM_1PNPDE20080512_114015_000000742068_00295_32413_8529.N1						IS2	V/V	68	32413	295	4.06
ASA_IMM_1PNPDE20080512_120346_000002602068_00295_32413_8563.N1						IS2	H/H	68	32413	295	4.06
ASA_IMM_1PNPDK20080512_120846_000004382068_00295_32413_1653.N1						IS2	H/H	68	32413	295	4.06
ASA_IMM_1PNPDE20080512_140431_000001412068_00296_32414_8611.N1						IS6	H/H	68	32414	296	4.06
ASA_IMM_1PNPDE20080512_141219_000000362068_00296_32414_8585.N1						IS2	V/V	68	32414	296	4.06
ASA_IMM_1PNPDE20080512_142234_000000802068_00297_32415_8609.N1						IS2	V/V	68	32415	297	4.06
ASA_IMM_1PNPDK20080512_143943_000000662068_00297_32415_1758.N1						IS2	H/H	68	32415	297	4.06
ASA_IMM_1PNPDE20080512_145404_000000512068_00297_32415_8593.N1						IS2	V/V	68	32415	297	4.06
ASA_IMM_1PNPDE20080512_153218_000001132068_00297_32415_8583.N1						IS2	H/H	68	32415	297	4.06
ASA_IMM_1PNPDE20080512_160446_000001132068_00298_32416_8621.N1						IS2	V/V	68	32416	298	4.06
ASA_IMM_1PNPDE20080512_170818_000002602068_00298_32416_8691.N1						IS2	H/H	68	32416	298	4.06
ASA_IMM_1PNPDE20080512_171120_000000782068_00298_32416_8673.N1						IS2	H/H	68	32416	298	4.06
ASA_IMM_1PNPDE20080512_171318_000003752068_00298_32416_8805.N1						IS2	H/H	68	32416	298	4.06
ASA_IMM_1PNPDE20080512_171920_000000132068_00298_32416_8643.N1						IS2	***	68	32416	298	4.06
ASA_IMM_1PNPDE20080512_174433_000001942068_00299_32417_8699.N1						IS6	V/V	68	32417	299	4.06
ASA_IMM_1PNPDE20080512_181602_000001552068_00299_32417_9784.N1						IS2	V/V	68	32417	299	4.06
ASA_IMM_1PNPDE20080512_185335_000000622068_00299_32417_8679.N1						IS2	H/H	68	32417	299	4.06
ASA_IMM_1PNPDE20080512_185335_000003092068_00299_32417_8807.N1						IS2	H/H	68	32417	299	4.06
ASA_IMM_1PNPDE20080512_185637_000000592068_00299_32417_8685.N1						IS2	H/H	68	32417	299	4.06
ASA_IMM_1PNPDK20080512_193743_000000512068_00300_32418_2121.N1						IS2	V/V	68	32418	300	4.06
ASA_IMM_1PNPDE20080512_202829_000001512068_00300_32418_8830.N1						IS2	H/H	68	32418	300	4.06
ASA_IMM_1PNPDK20080512_211134_000000672068_00301_32419_2156.N1						IS2	V/V	68	32419	301	4.06
ASA_IMM_1PNPDE20080512_211134_000000502068_00301_32419_8957.N1						IS2	V/V	68	32419	301	4.06
ASA_IMM_1PNPDE20080512_213342_000000812068_00301_32419_8965.N1						IS2	V/V	68	32419	301	4.06
ASA_IMM_1PNPDE20080512_221402_000003682068_00301_32419_8983.N1						IS2	H/H	68	32419	301	4.06
ASA_IMM_1PNPDE20080512_224722_000000512068_00302_32420_8963.N1						IS2	V/V	68	32420	302	4.06
ASA_IMM_1PNPDE20080512_234813_000000802068_00302_32420_9125.N1						IS2	H/H	68	32420	302	4.06
ASA_IMM_1PNPDE20080512_235013_000000802068_00302_32420_9008.N1						IS2	H/H	68	32420	302	4.06
ASA_IMM_1PNPDE20080512_235213_000004892068_00302_32420_9166.N1						IS2	H/H	68	32420	302	4.06





Filename	Pol	Timestamp	count(Module)
ASA_MS__0PNPDE20080512_015923_000000162068_00289_32407_0286.N1	H	2008-05-12 01:59:23	320
ASA_MS__0PNPDK20080512_084147_000000162068_00293_32411_0542.N1	V	2008-05-12 08:41:47	320


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WSM_1PNPDE20080512_110848_000002442068_00295_32413_8569.N1						SS1	H/H	68	32413	295	4.06
ASA_WSM_1PNPDE20080512_110848_000002442068_00295_32413_8577.N1						SS1	H/H	68	32413	295	4.06
ASA_WSM_1PNPDE20080512_113442_000000852068_00295_32413_8541.N1						SS1	V/V	68	32413	295	4.06
ASA_WSM_1PNPDE20080512_142113_000000672068_00297_32415_8587.N1						SS1	V/V	68	32415	297	4.06
ASA_WSM_1PNPDE20080512_145532_000002252068_00297_32415_8625.N1						SS1	V/V	68	32415	297	4.06
ASA_WSM_1PNPDE20080512_155715_000000672068_00297_32415_8627.N1						SS1	V/V	68	32415	297	4.06
ASA_WSM_1PNPDE20080512_155715_000000862068_00297_32415_8803.N1						SS1	V/V	68	32415	297	4.06
ASA_WSM_1PNPDE20080512_160304_000000852068_00298_32416_8623.N1						SS1	H/H	68	32416	298	4.06
ASA_WSM_1PNPDE20080512_180617_000000672068_00299_32417_8693.N1						SS1	H/H	68	32417	299	4.06
ASA_WSM_1PNPDE20080512_180617_000001832068_00299_32417_8828.N1						SS1	H/H	68	32417	299	4.06
ASA_WSM_1PNPDE20080512_180825_000000552068_00299_32417_8697.N1						SS1	H/H	68	32417	299	4.06
ASA_WSM_1PNPDE20080512_191919_000002142068_00300_32418_8865.N1						SS1	H/H	68	32418	300	4.06
ASA_WSM_1PNPDE20080512_204658_000005742068_00300_32418_8967.N1						SS1	V/V	68	32418	300	4.06
ASA_WSM_1PNPDE20080512_204658_000005742068_00300_32418_9123.N1						SS1	V/V	68	32418	300	4.06
ASA_WSM_1PNPDE20080512_230127_000002442068_00302_32420_9378.N1						SS1	H/H	68	32420	302	4.06
ASA_WSM_1PNPDE20080512_230234_000001762068_00302_32420_9168.N1						SS1	H/H	68	32420	302	4.06




Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20080511_234729_000009892068_00288_32406_7697.N1						IS2	V/V	68	32406	288	4.06
ASA_WVS_1PNPDE20080512_001330_000002702068_00288_32406_7700.N1						IS2	V/V	68	32406	288	4.06
ASA_WVS_1PNPDE20080512_003453_000003892068_00288_32406_7707.N1						IS2	V/V	68	32406	288	4.06
ASA_WVS_1PNPDE20080512_004038_000004192068_00288_32406_7864.N1						IS2	V/V	68	32406	288	4.06
ASA_WVS_1PNPDE20080512_003453_000003892068_00288_32406_7707.N1						IS1	V/V	68	32406	288	4.06
ASA_WVS_1PNPDE20080512_005111_000007342068_00288_32406_7855.N1						IS2	V/V	68	32406	288	4.06
ASA_WVS_1PNPDE20080512_013245_000008852068_00289_32407_7877.N1						IS2	V/V	68	32407	289	4.06
ASA_WVS_1PNPDE20080512_015306_000003302068_00289_32407_7874.N1						IS2	V/V	68	32407	289	4.06
ASA_WVS_1PNPDE20080512_021529_000001052068_00289_32407_7867.N1						IS2	V/V	68	32407	289	4.06
ASA_WVS_1PNPDE20080512_021629_000003152068_00289_32407_7995.N1						IS2	V/V	68	32407	289	4.06
ASA_WVS_1PNPDE20080512_023539_000003892068_00290_32408_8021.N1						IS2	V/V	68	32408	290	4.06
ASA_WVS_1PNPDE20080512_031908_000000892068_00290_32408_8016.N1						IS2	V/V	68	32408	290	4.06
ASA_WVS_1PNPDE20080512_032217_000006292068_00290_32408_8013.N1						IS2	V/V	68	32408	290	4.06
ASA_WVS_1PNPDE20080512_033232_000002402068_00290_32408_8136.N1						IS2	V/V	68	32408	290	4.06
ASA_WVS_1PNPDE20080512_040031_000009442068_00290_32408_8145.N1						IS2	V/V	68	32408	290	4.06
ASA_WVS_1PNPDE20080512_041830_000000742068_00291_32409_8166.N1						IS2	V/V	68	32409	291	4.06
ASA_WVS_1PNPDE20080512_045959_000008392068_00291_32409_8184.N1						IS2	V/V	68	32409	291	4.06
ASA_WVS_1PNPDE20080512_051343_000003752068_00291_32409_8307.N1						IS2	V/V	68	32409	291	4.06
ASA_WVS_1PNPDE20080512_053641_000015442068_00291_32409_8341.N1						IS2	V/V	68	32409	291	4.06
ASA_WVS_1PNPDE20080512_064411_000006442068_00292_32410_8344.N1						IS2	V/V	68	32410	292	4.06
ASA_WVS_1PNPDK20080512_065441_000003452068_00292_32410_1144.N1						IS2	V/V	68	32410	292	4.06
ASA_WVS_1PNPDK20080512_071717_000019042068_00292_32410_1163.N1						IS2	V/V	68	32410	292	4.06
ASA_WVS_1PNPDK20080512_083228_000005252068_00293_32411_1234.N1						IS2	V/V	68	32411	293	4.06
ASA_WVS_1PNPDK20080512_085753_000020242068_00293_32411_1255.N1						IS2	V/V	68	32411	293	4.06
ASA_WVS_1PNPDK20080512_100435_000010192068_00294_32412_1397.N1						IS2	V/V	68	32412	294	4.06
ASA_WVS_1PNPDK20080512_103829_000003002068_00294_32412_1394.N1						IS2	V/V	68	32412	294	4.06
ASA_WVS_1PNPDK20080512_104512_000013642068_00294_32412_1428.N1						IS2	V/V	68	32412	294	4.06
ASA_WVS_1PNPDK20080512_112755_000003602068_00295_32413_1503.N1						IS2	V/V	68	32413	295	4.06
ASA_WVS_1PNPDK20080512_113605_000002092068_00295_32413_1506.N1						IS2	V/V	68	32413	295	4.06
ASA_WVS_1PNPDK20080512_114136_000012442068_00295_32413_1516.N1						IS2	V/V	68	32413	295	4.06
ASA_WVS_1PNPDK20080512_121905_000004052068_00295_32413_1519.N1						IS2	V/V	68	32413	295	4.06
ASA_WVS_1PNPDK20080512_123038_000010212068_00295_32413_1526.N1						IS2	V/V	68	32413	295	4.06
ASA_WVS_1PNPDK20080512_130946_000008692068_00296_32414_1666.N1						IS2	V/V	68	32414	296	4.06
ASA_WVS_1PNPDK20080512_135941_000002552068_00296_32414_1669.N1						IS2	V/V	68	32414	296	4.06
ASA_WVS_1PNPDK20080512_141302_000004342068_00296_32414_1687.N1						IS2	V/V	68	32414	296	4.06
ASA_WVS_1PNPDK20080512_145917_000003892068_00297_32415_1786.N1						IS2	V/V	68	32415	297	4.06
ASA_WVS_1PNPDK20080512_150904_000008692068_00297_32415_1793.N1						IS2	V/V	68	32415	297	4.06
ASA_WVS_1PNPDK20080512_154017_000009742068_00297_32415_1796.N1						IS2	V/V	68	32415	297	4.06
ASA_WVS_1PNPDK20080512_155839_000002092068_00298_32416_1801.N1						IS2	V/V	68	32416	298	4.06
ASA_WVS_1PNPDK20080512_164303_000012592068_00298_32416_1908.N1						IS2	V/V	68	32416	298	4.06
ASA_WVS_1PNPDK20080512_172044_000013942068_00298_32416_1922.N1						IS2	V/V	68	32416	298	4.06
ASA_WVS_1PNPDK20080512_181844_000015592068_00299_32417_2040.N1						IS2	V/V	68	32417	299	4.06
ASA_WVS_1PNPDK20080512_190129_000000602068_00299_32417_2037.N1						IS2	V/V	68	32417	299	4.06
ASA_WVS_1PNPDK20080512_190501_000007642068_00299_32417_2052.N1						IS2	V/V	68	32417	299	4.06
ASA_WVS_1PNPDE20080512_195224_000019792068_00300_32418_8710.N1						IS2	V/V	68	32418	300	4.06
ASA_WVS_1PNPDE20080512_204205_000002392068_00300_32418_8738.N1						IS2	V/V	68	32418	300	4.06
ASA_WVS_1PNPDE20080512_204520_000000452068_00300_32418_8861.N1						IS2	V/V	68	32418	300	4.06
ASA_WVS_1PNPDE20080512_204205_000002392068_00300_32418_8738.N1						IS1	V/V	68	32418	300	4.06
ASA_WVS_1PNPDE20080512_213511_000018442068_00301_32419_8884.N1						IS2	V/V	68	32419	301	4.06
ASA_WVS_1PNPDE20080512_222241_000004192068_00301_32419_8879.N1						IS2	V/V	68	32419	301	4.06
ASA_WVS_1PNPDE20080512_222841_000006892068_00301_32419_9001.N1						IS2	V/V	68	32419	301	4.06
ASA_WVS_1PNPDE20080512_222241_000004192068_00301_32419_8879.N1						IS1	V/V	68	32419	301	4.06
ASA_WVS_1PNPDE20080512_224819_000004502068_00302_32420_9006.N1						IS2	V/V	68	32420	302	4.06
ASA_WVS_1PNPDE20080512_231322_000013042068_00302_32420_9017.N1						IS2	V/V	68	32420	302	4.06
ASA_WVS_1PNPDE20080512_234119_000003152068_00302_32420_9020.N1						IS2	V/V	68	32420	302	4.06

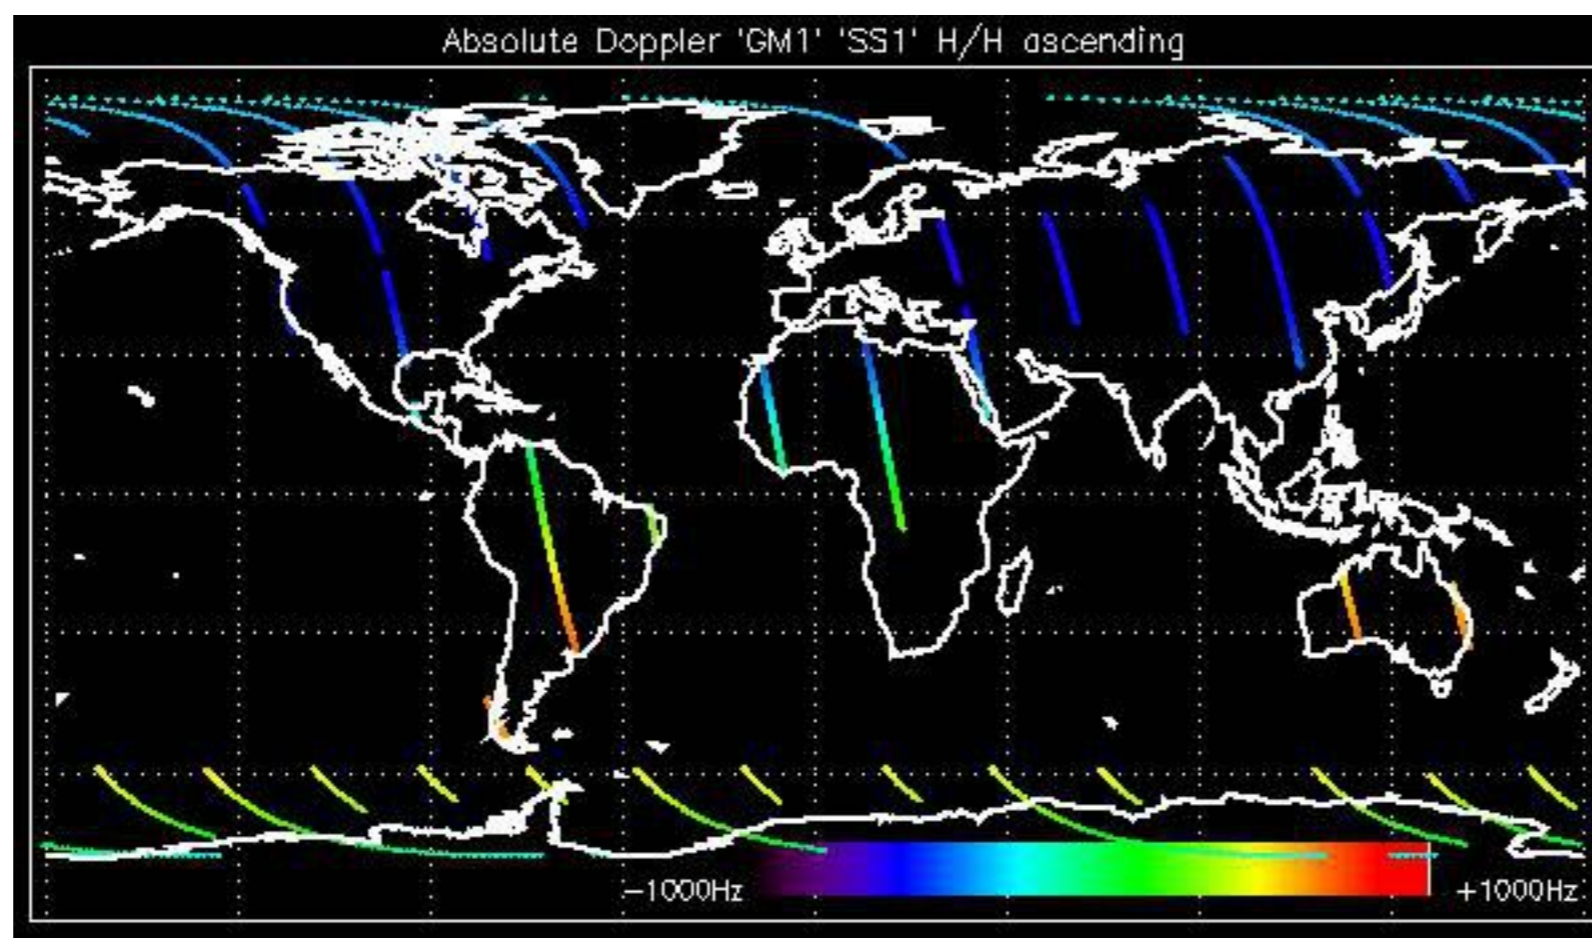



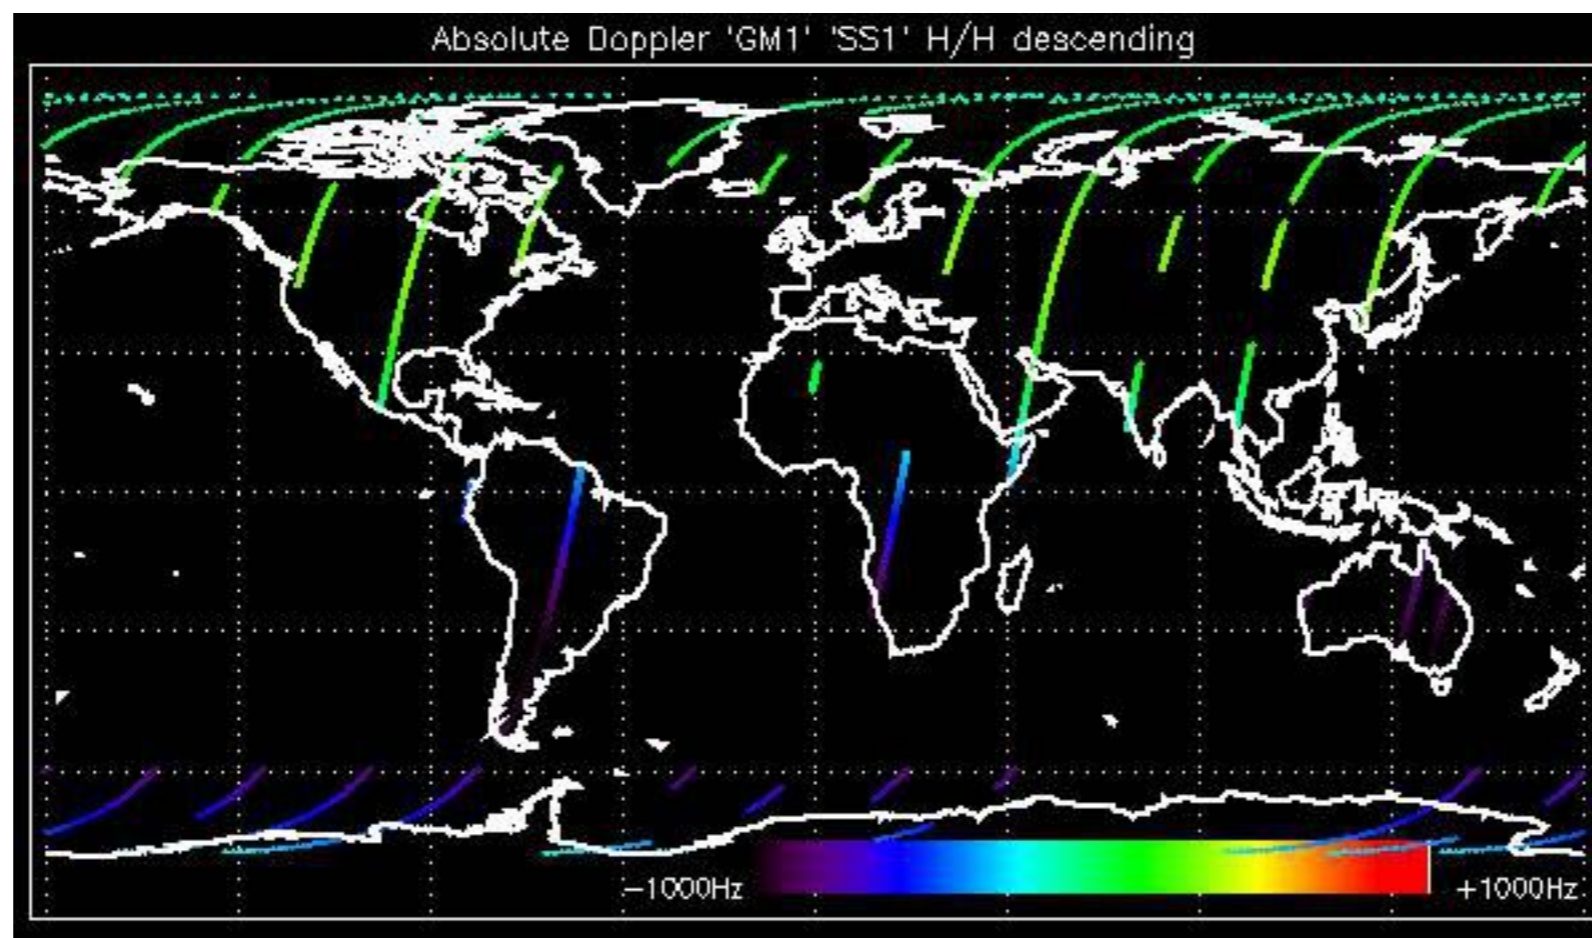


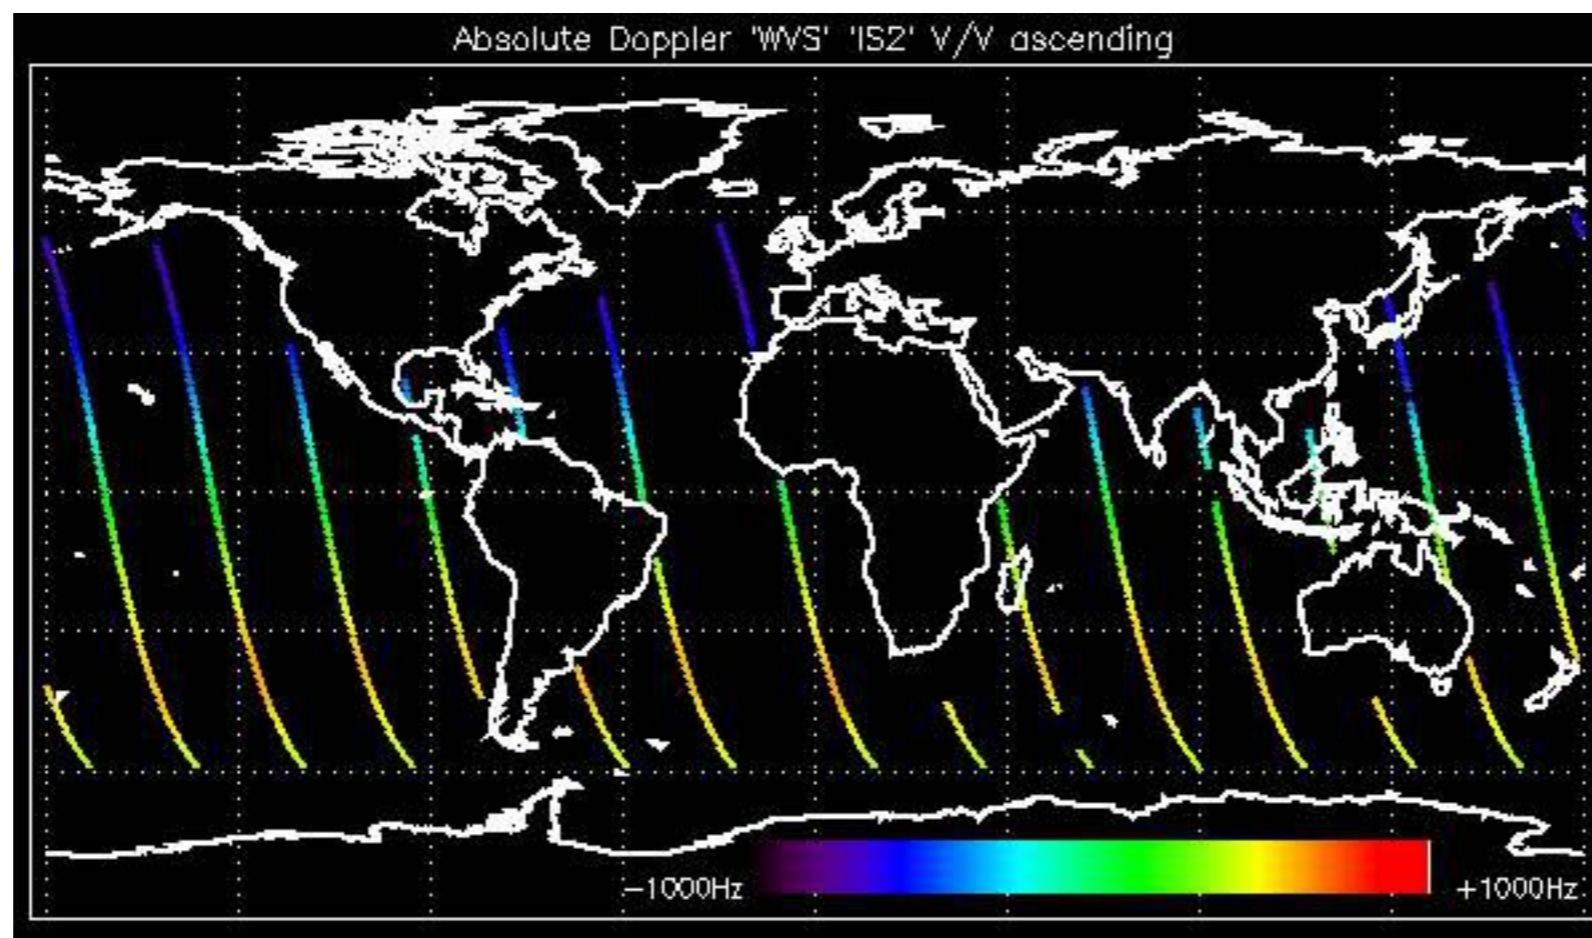


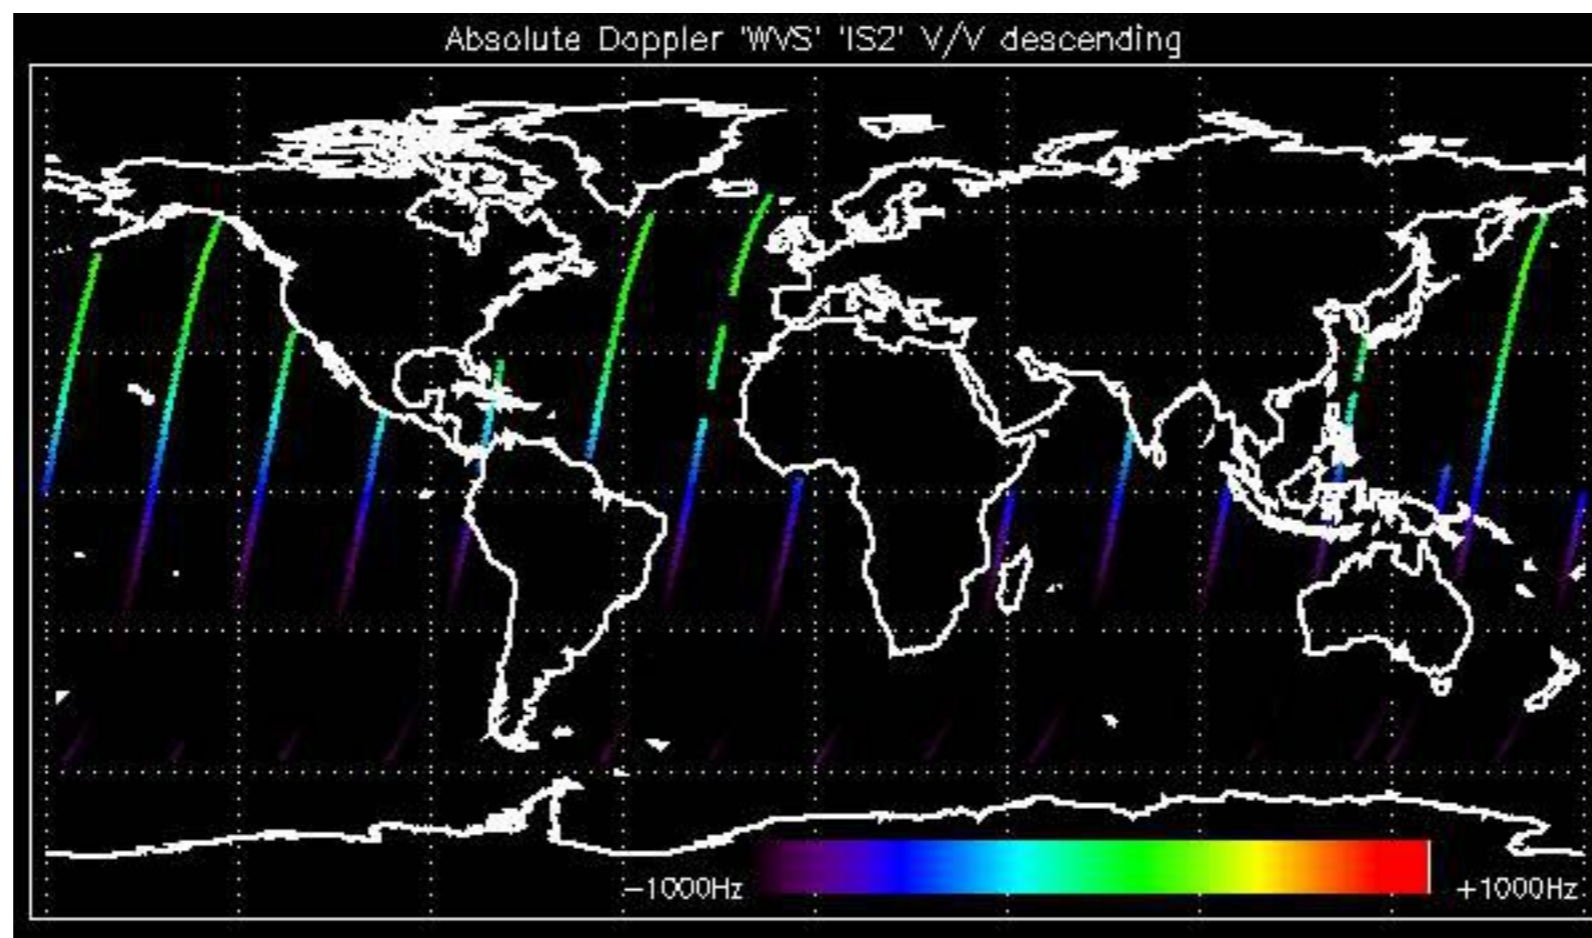


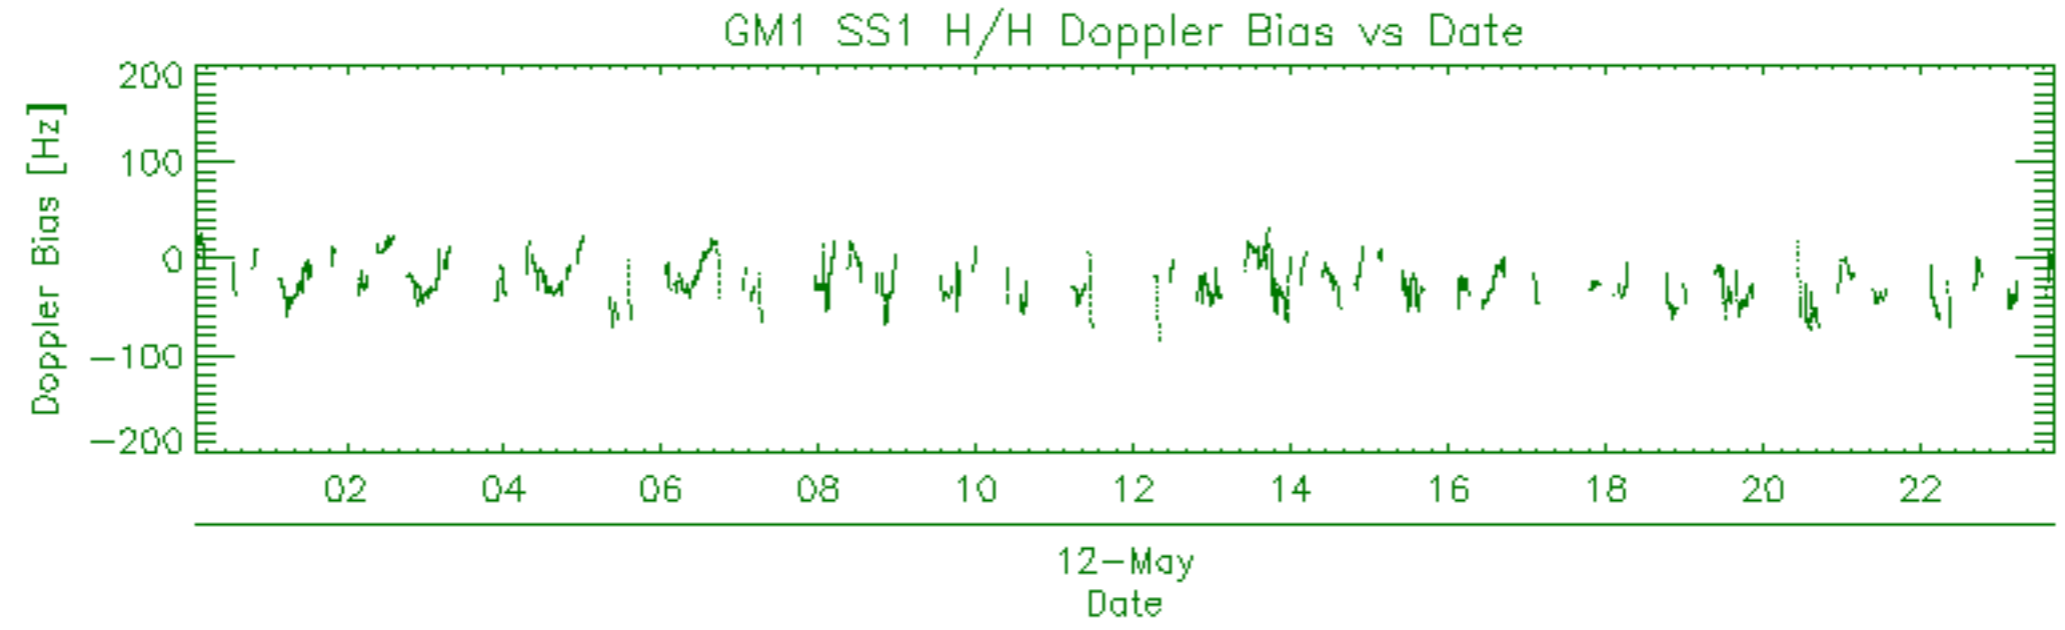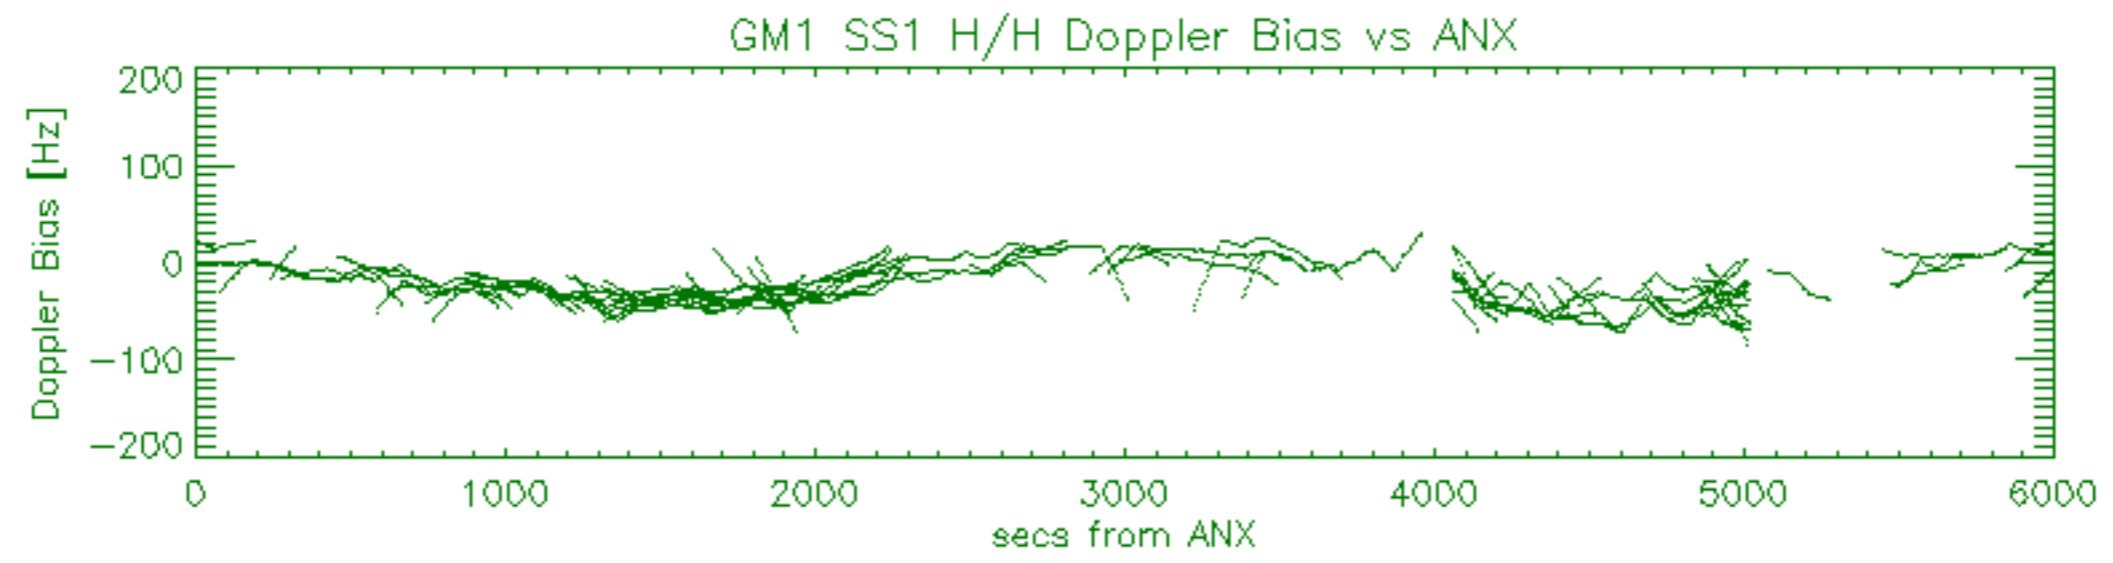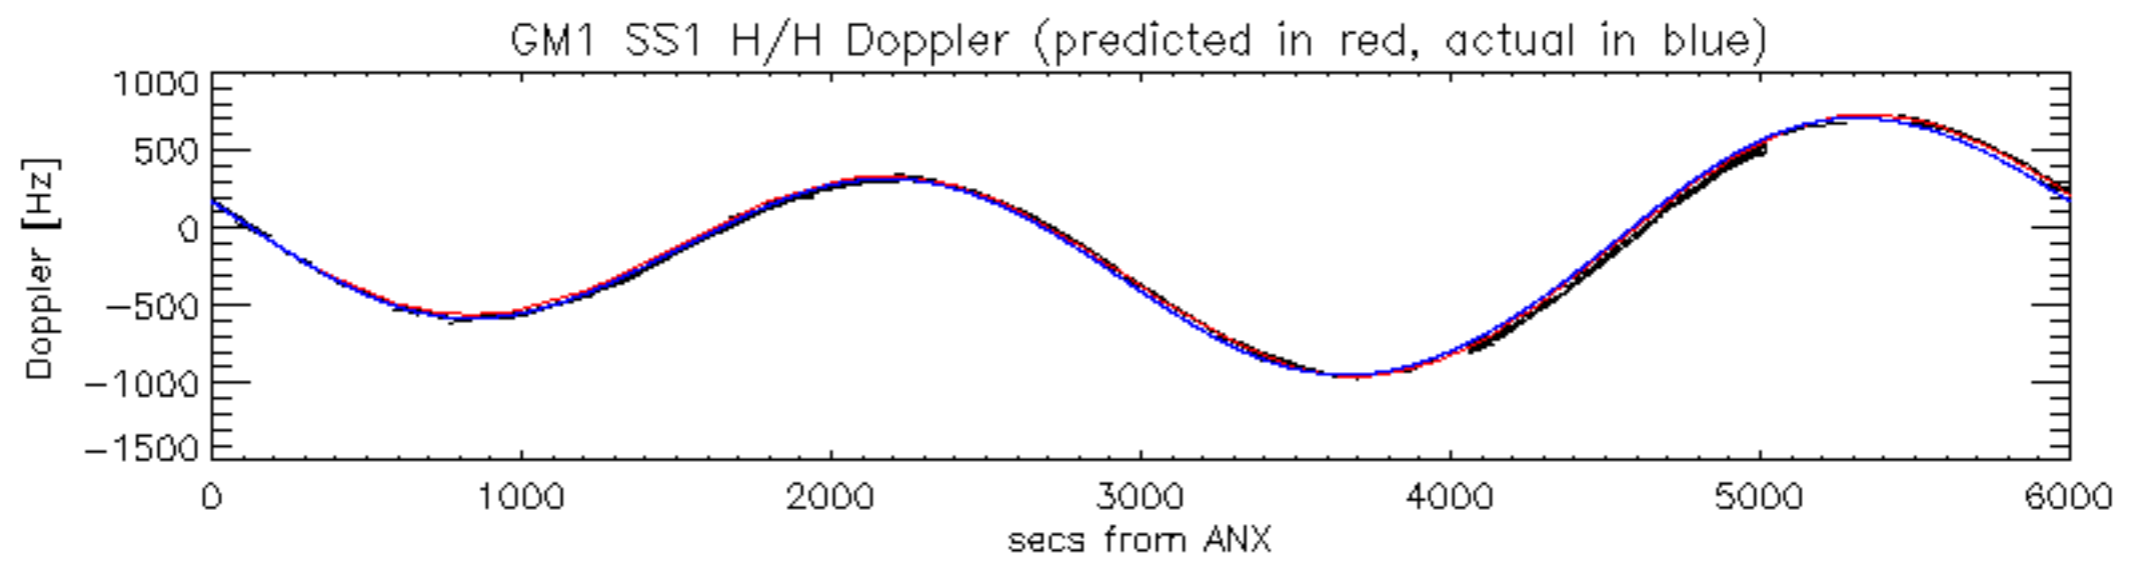






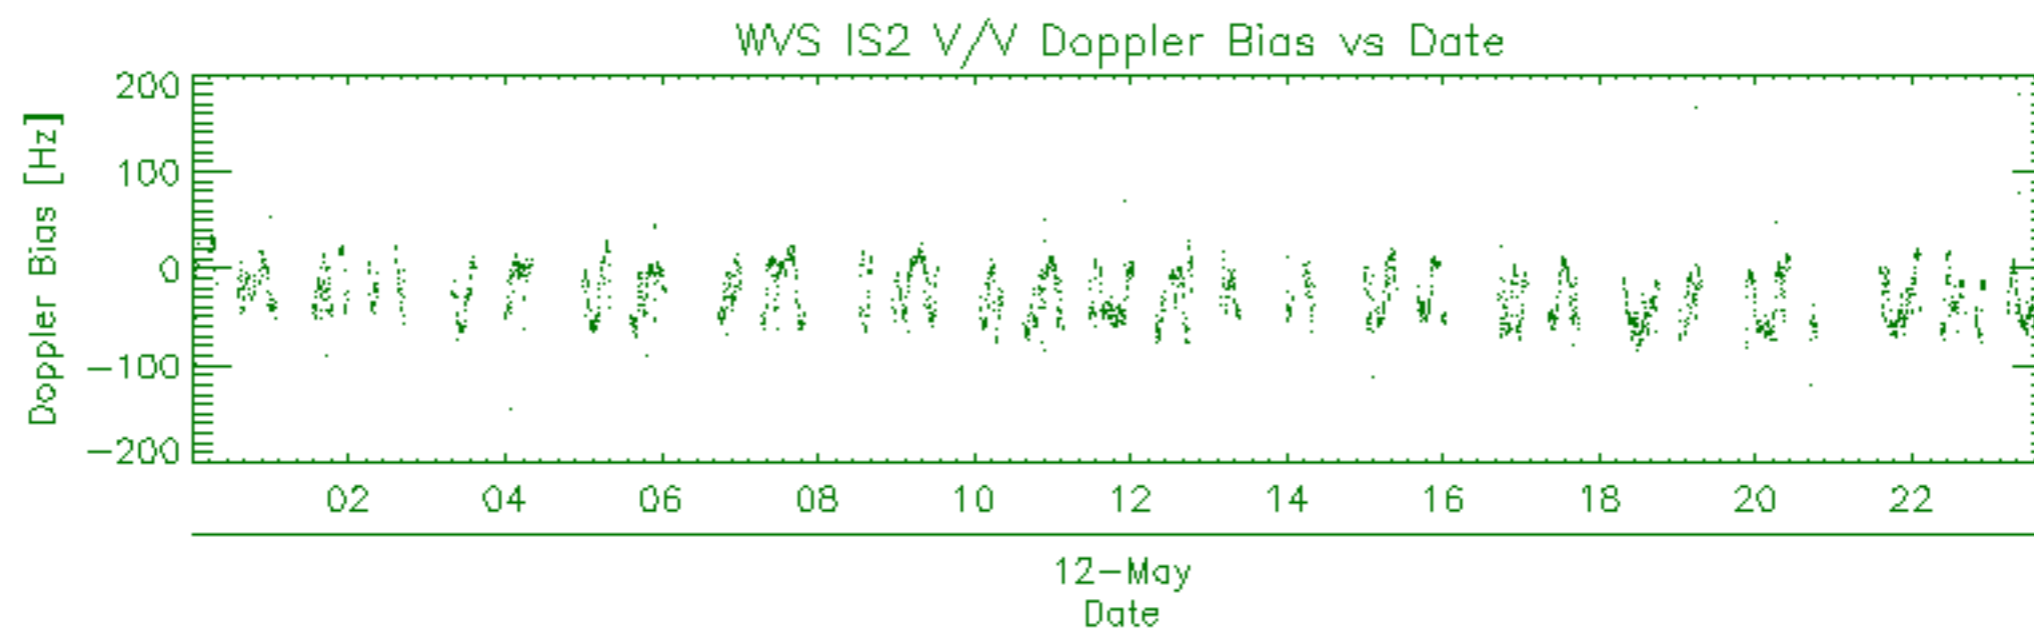
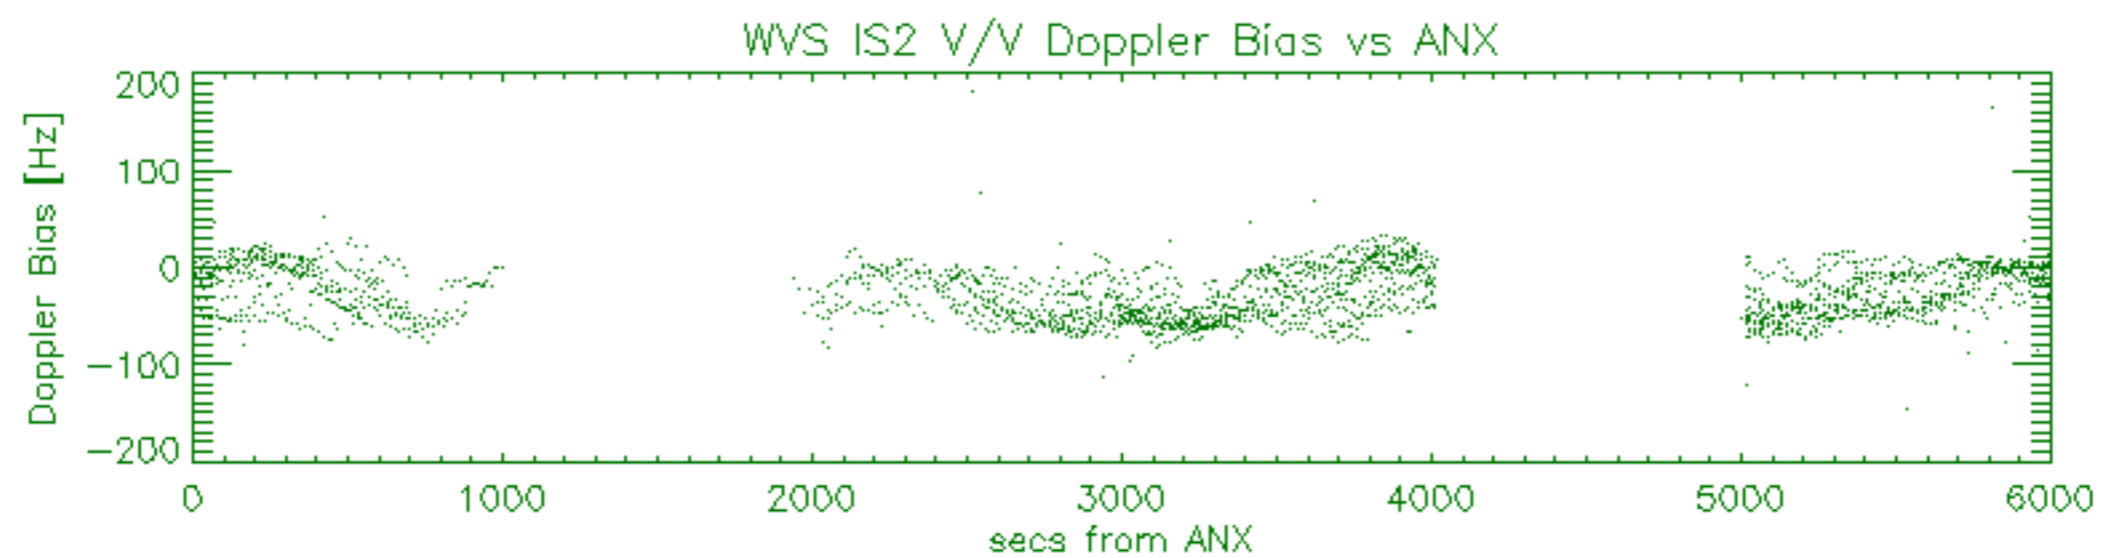
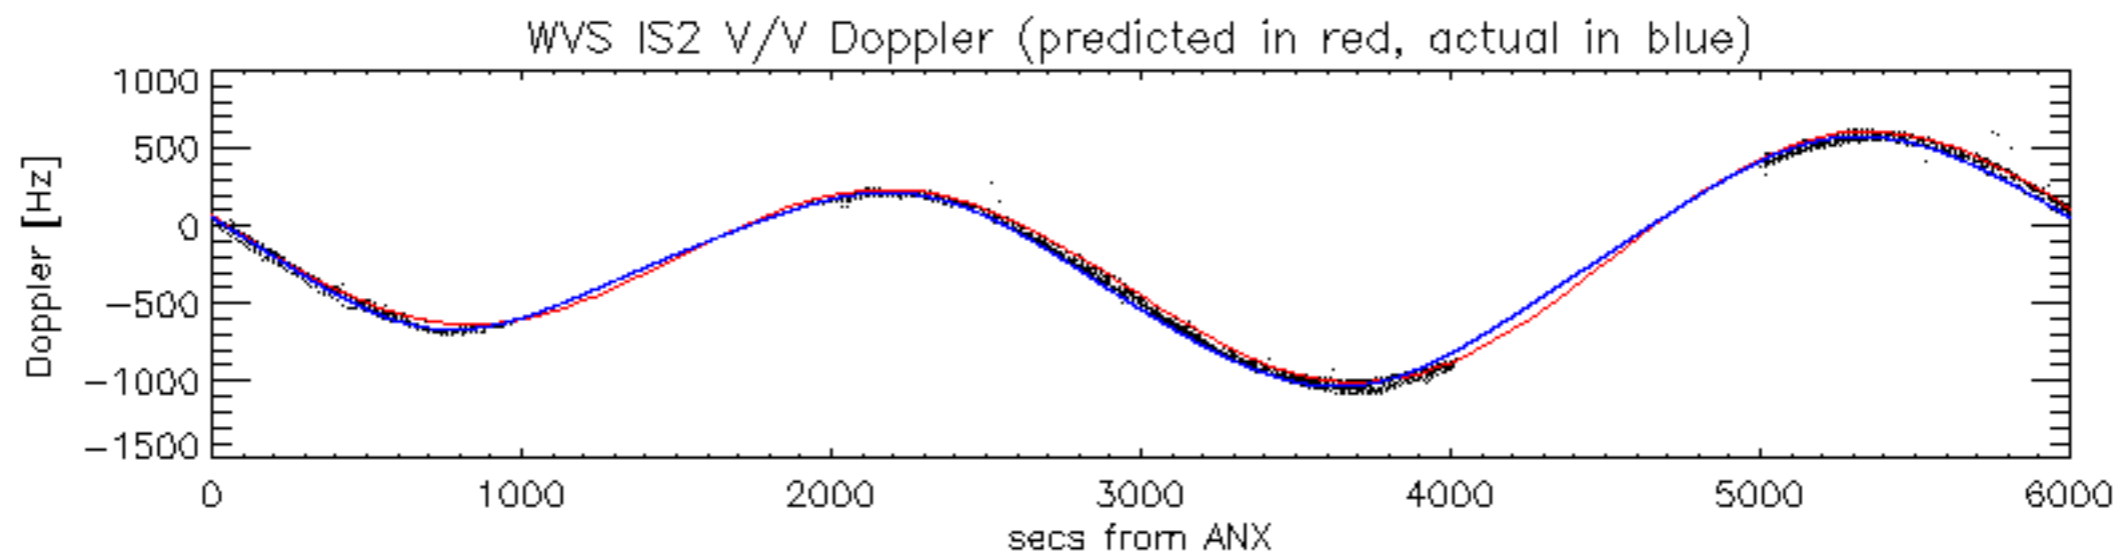


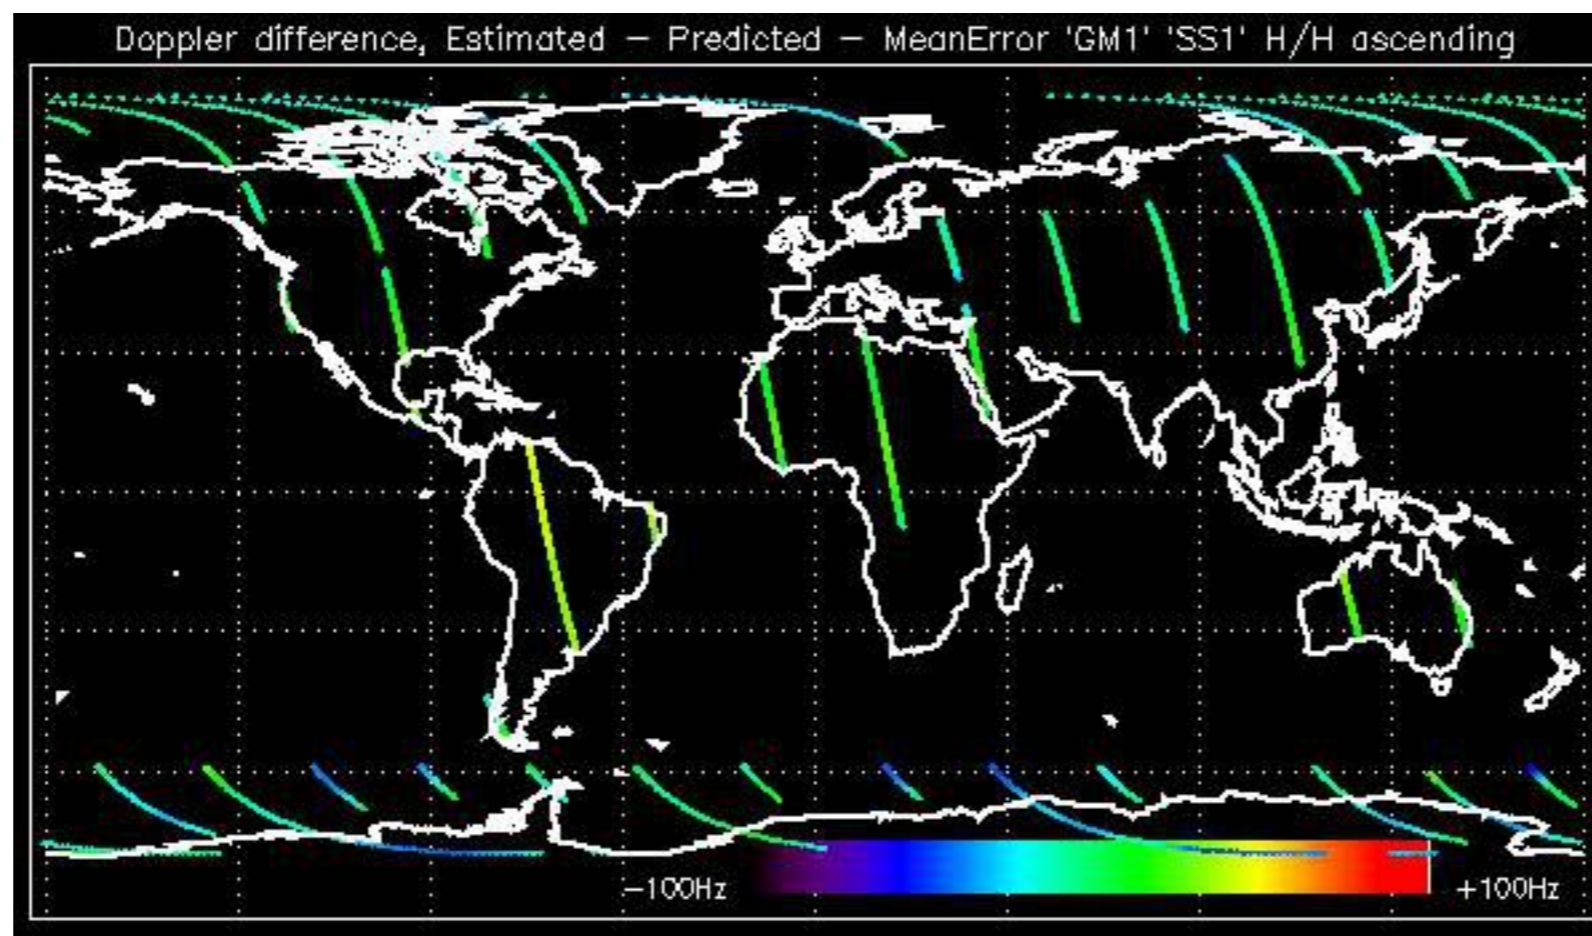


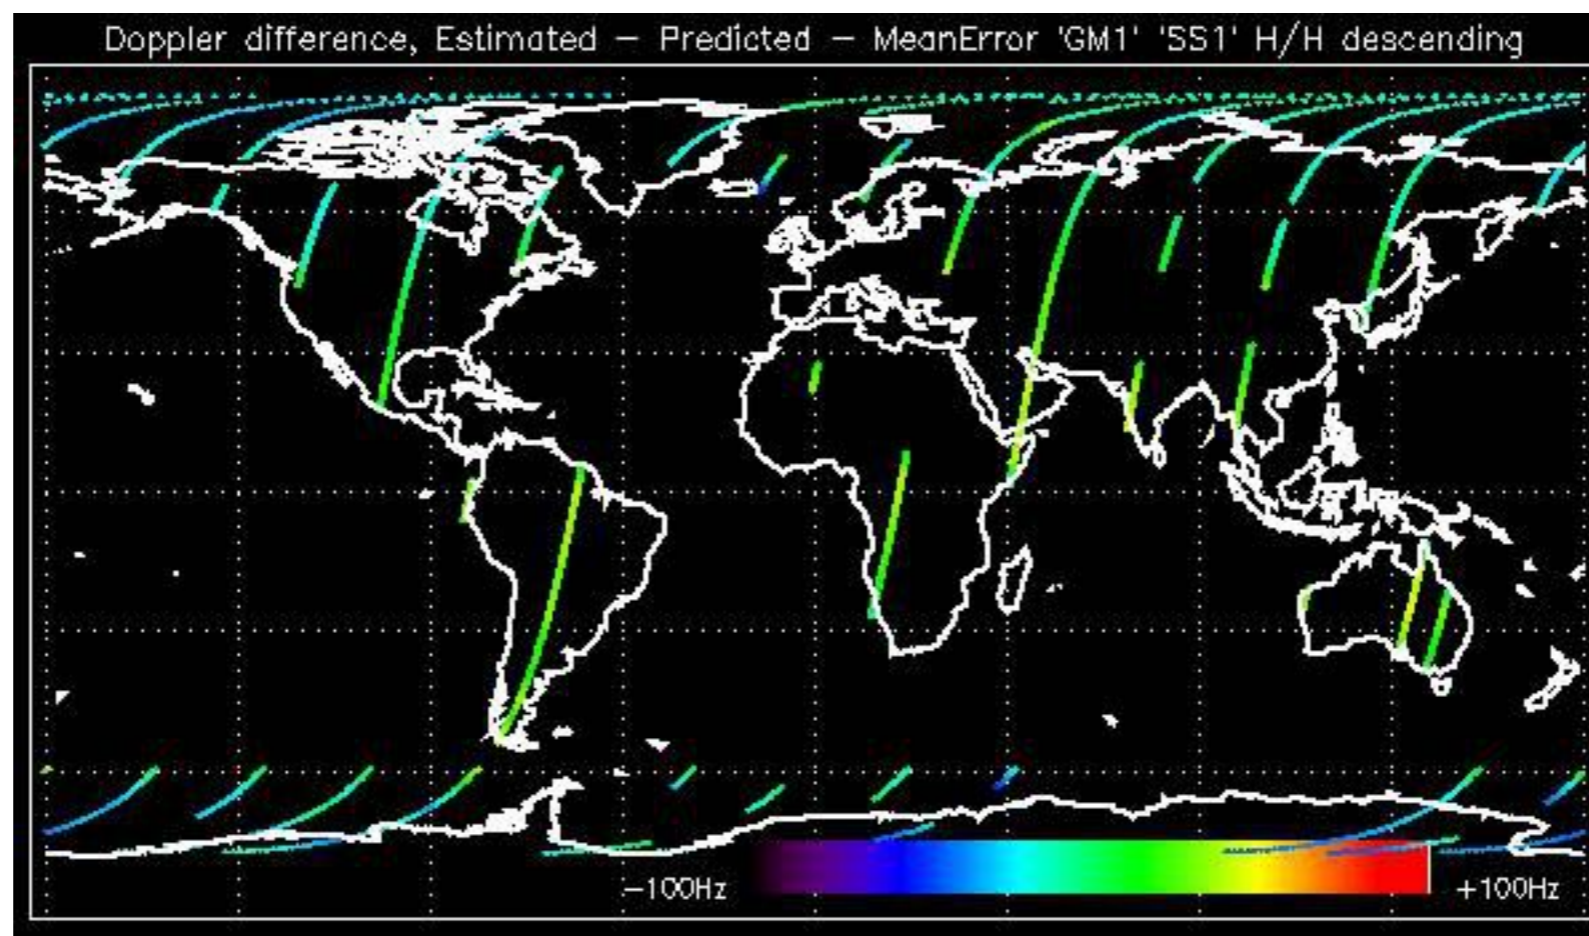

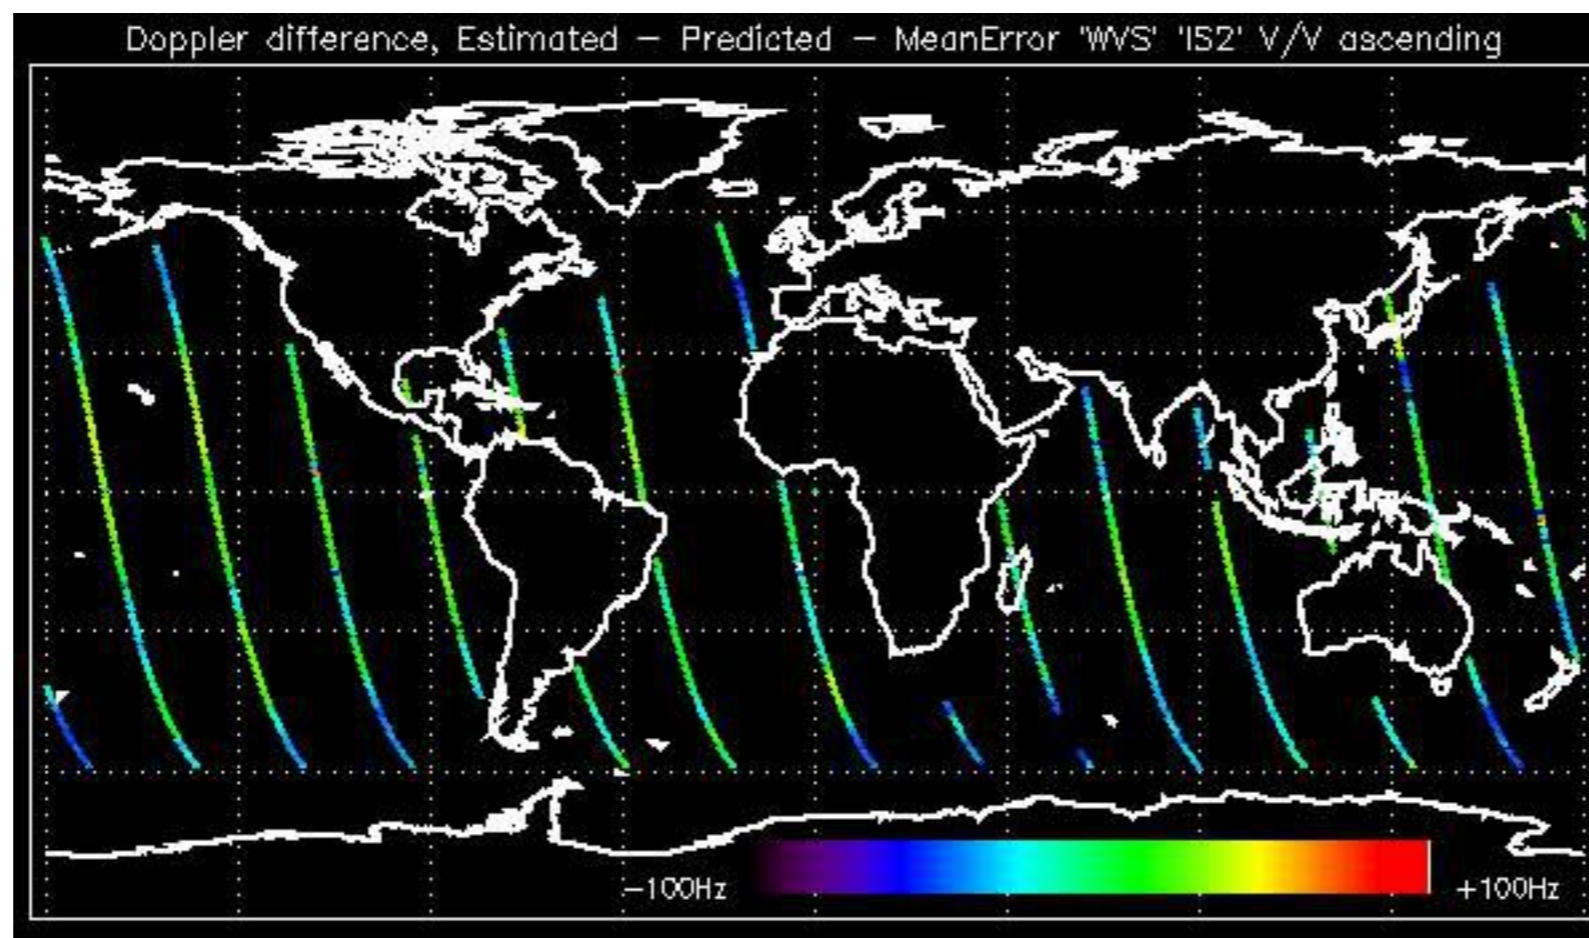

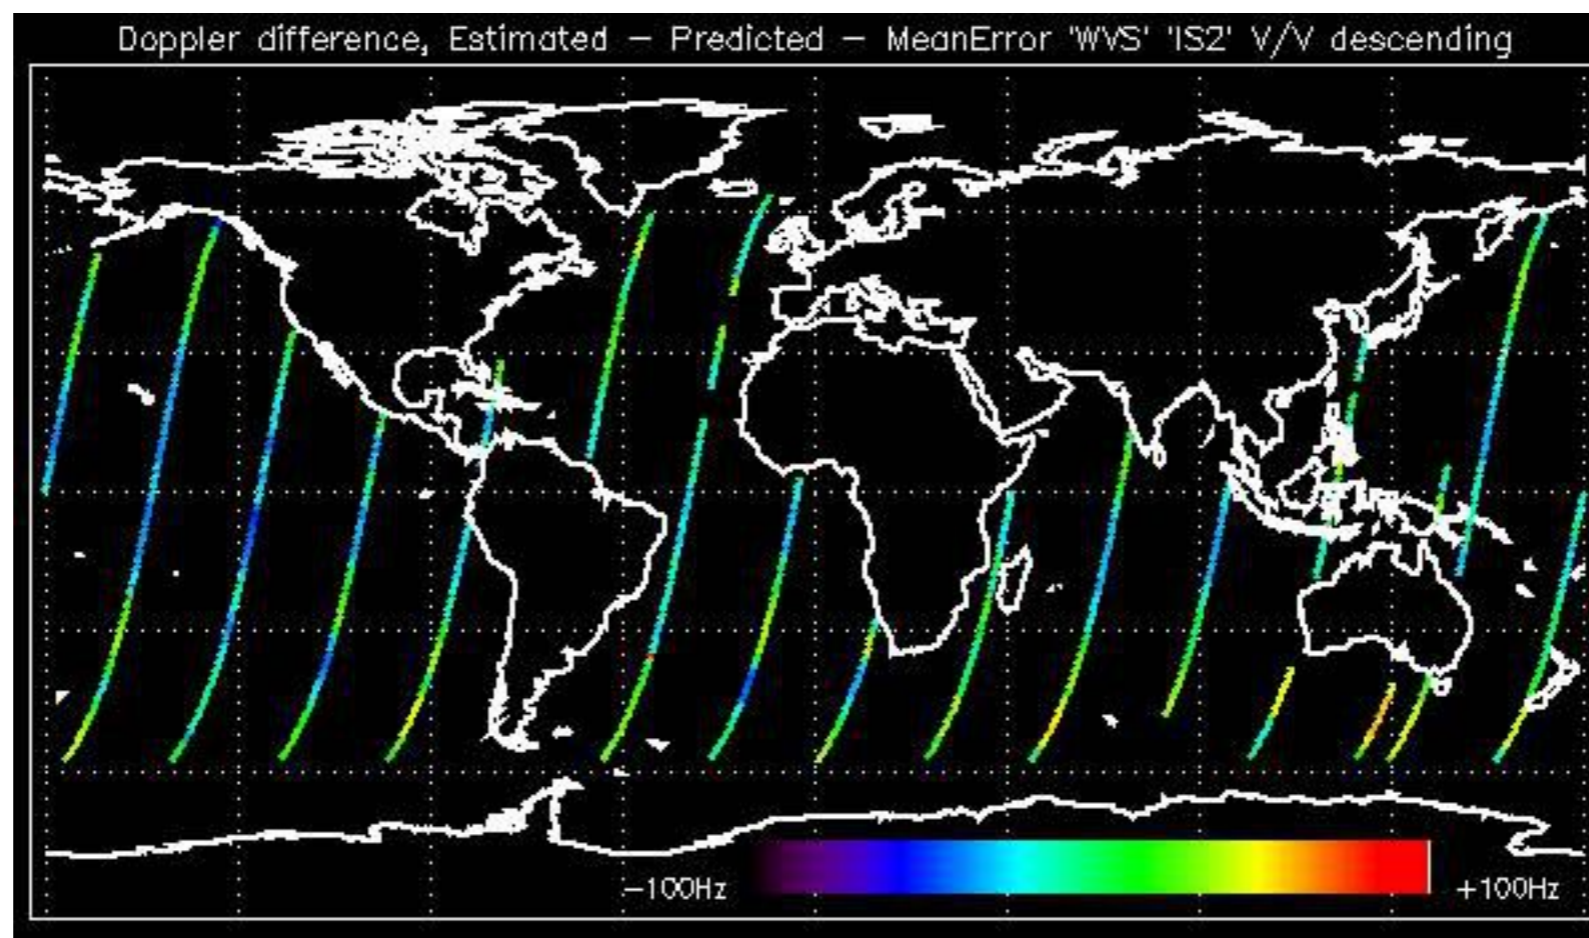

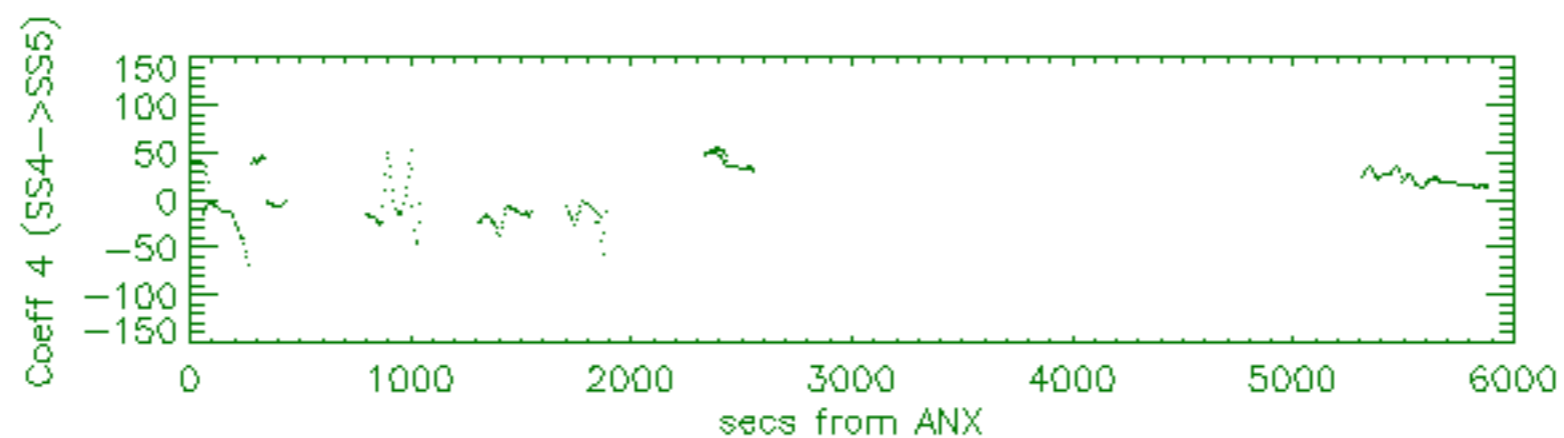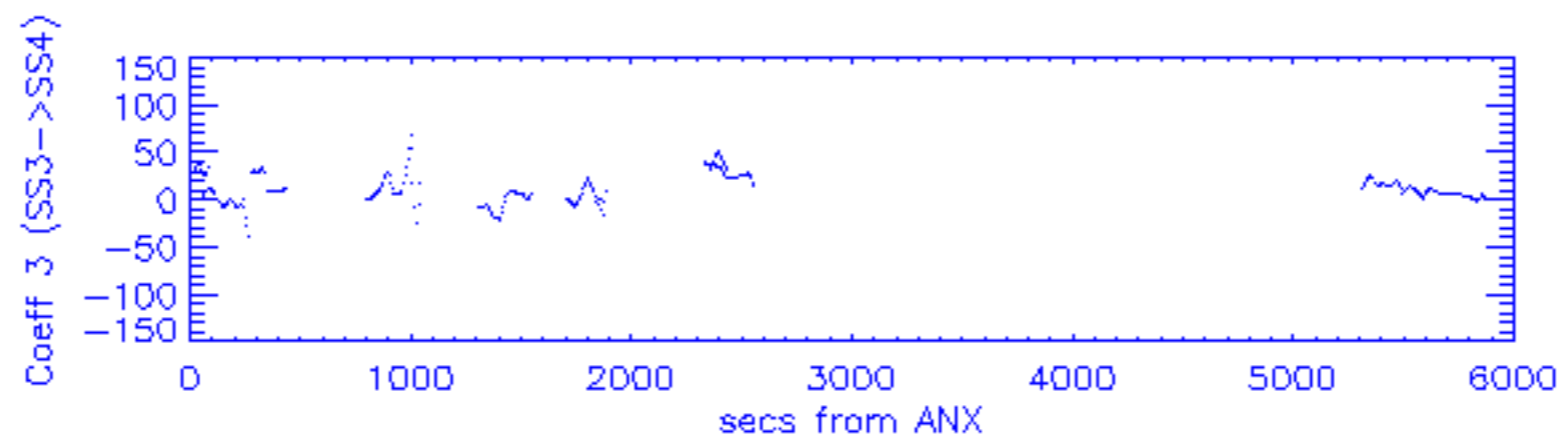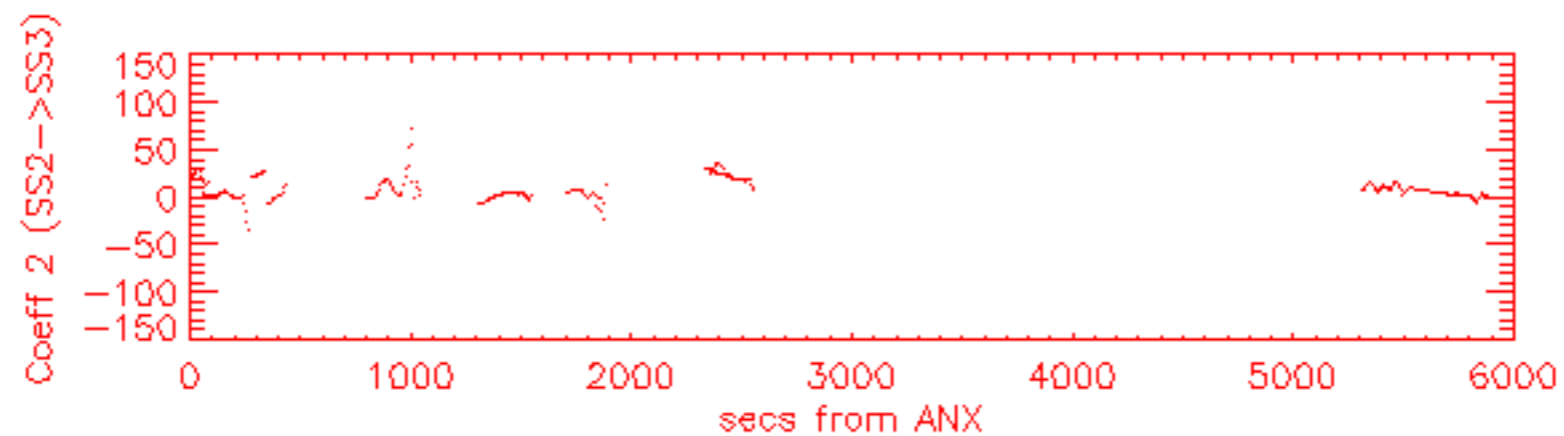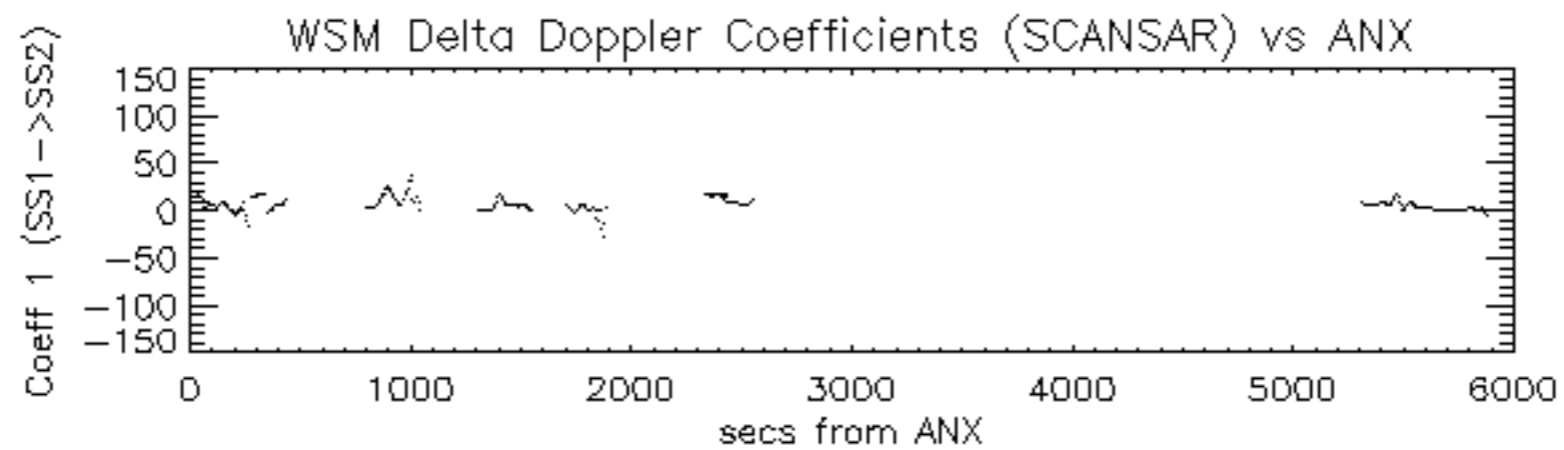

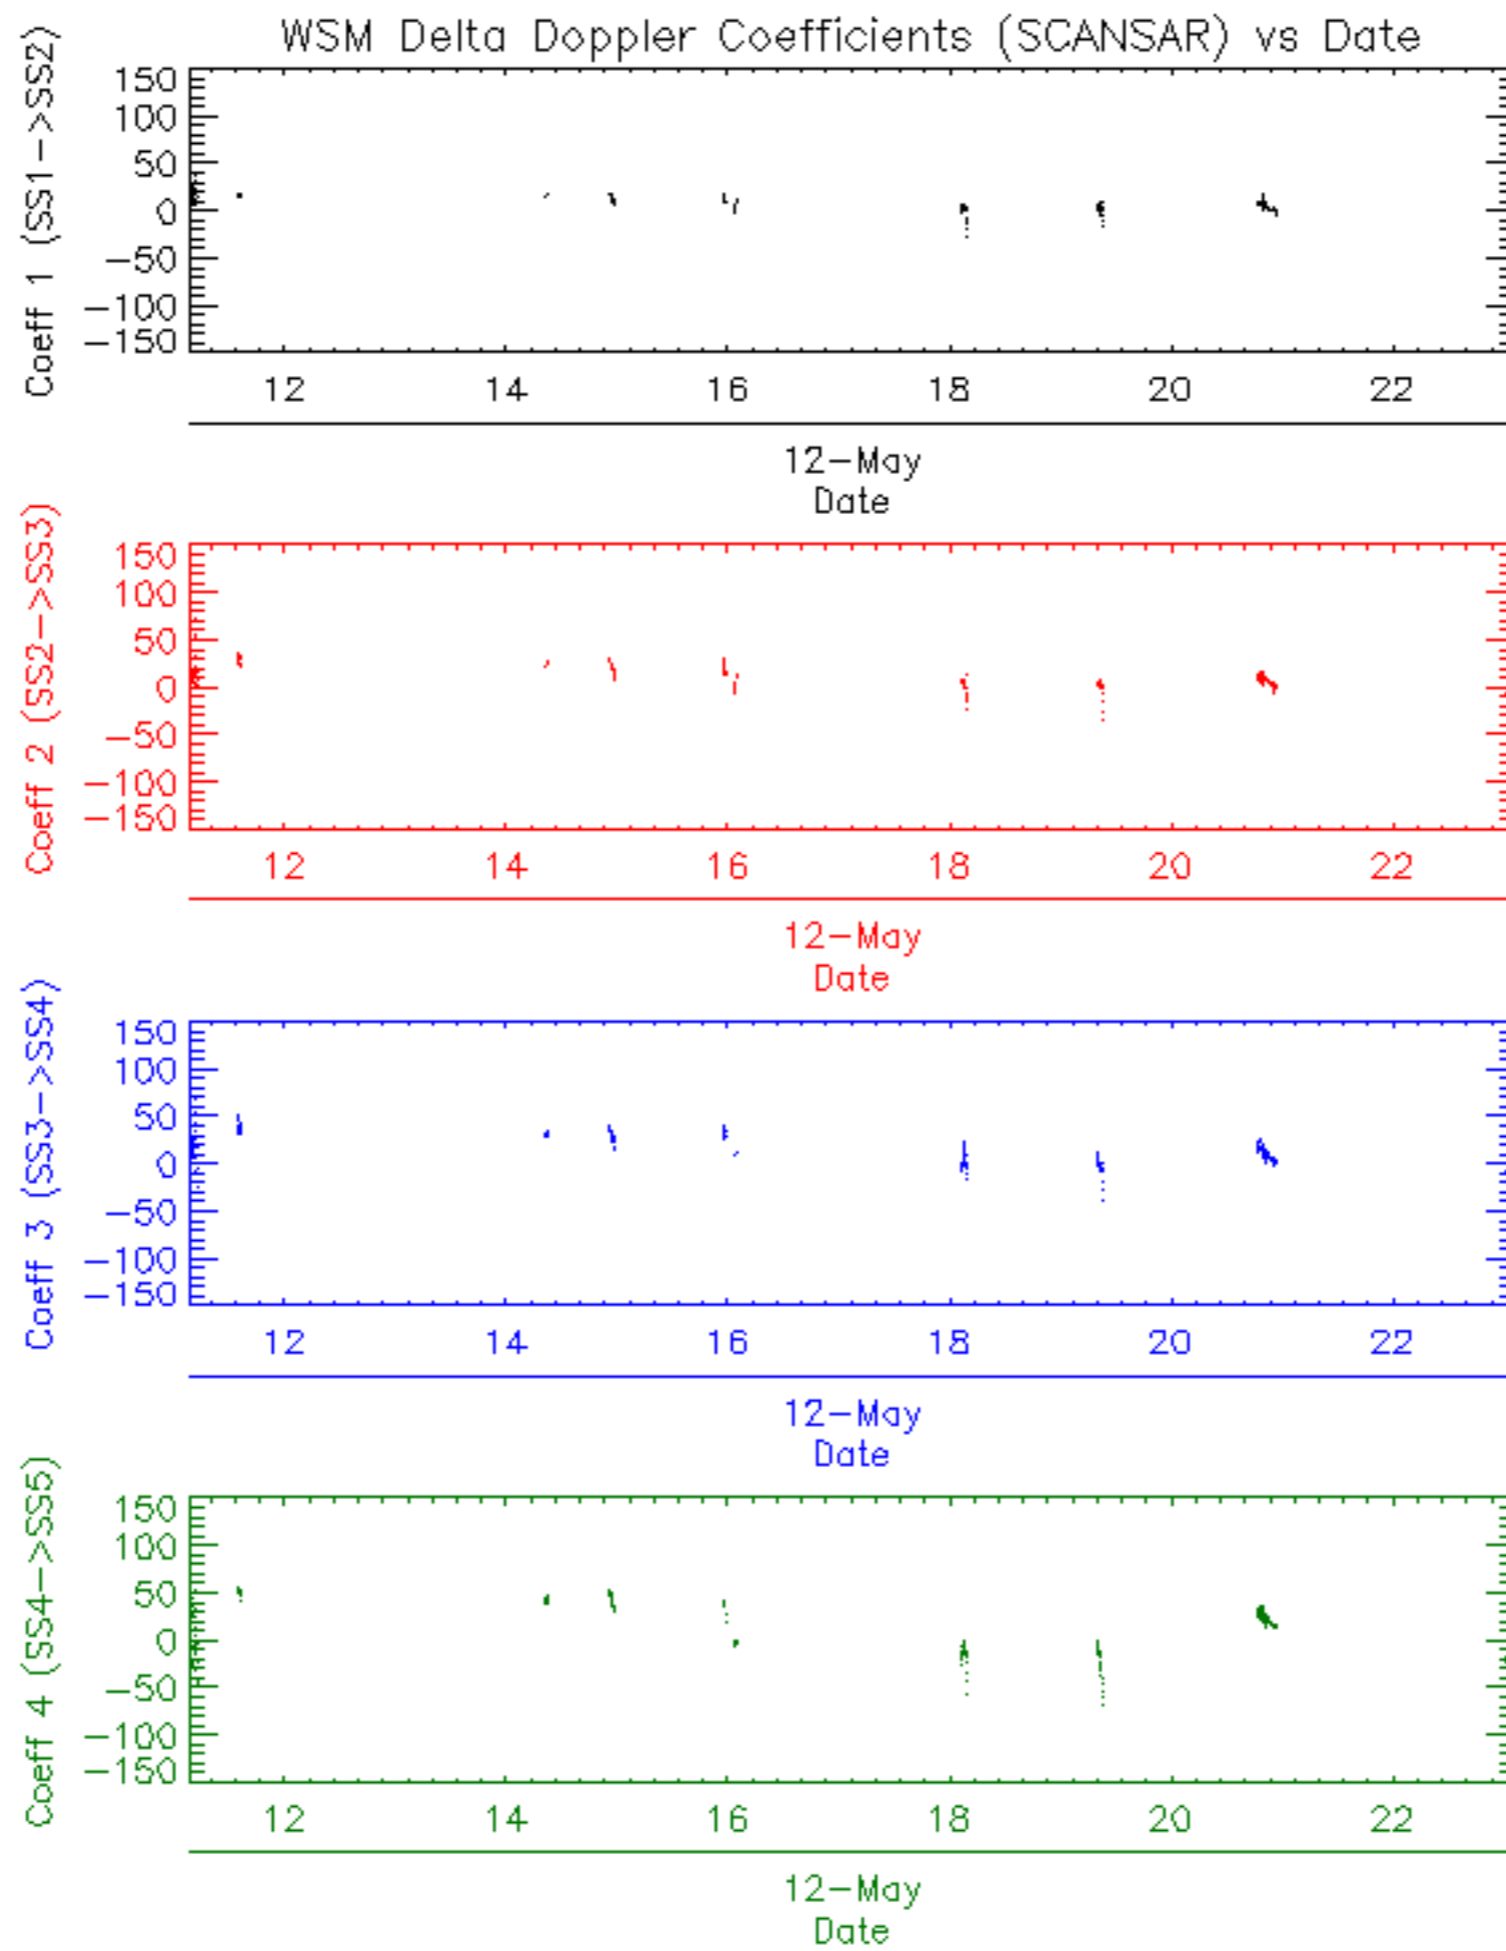






















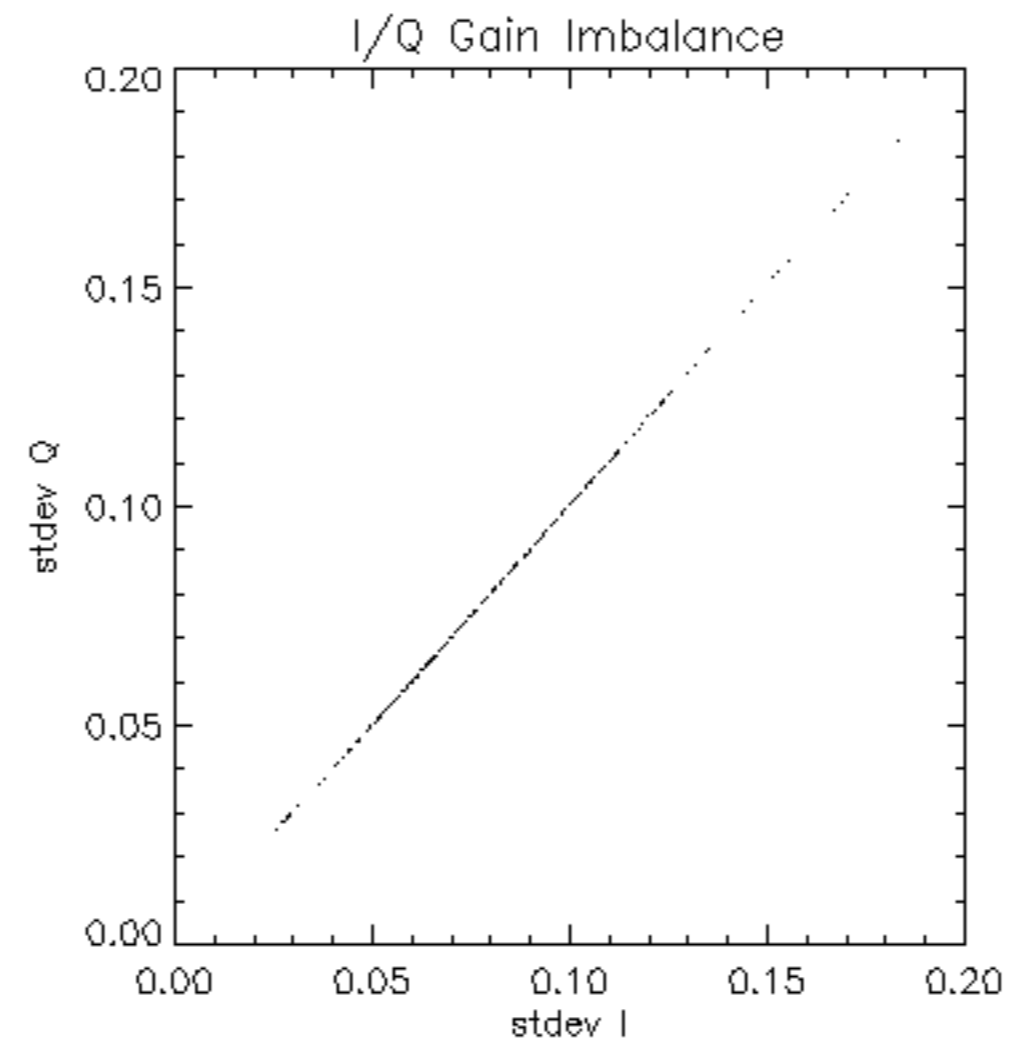




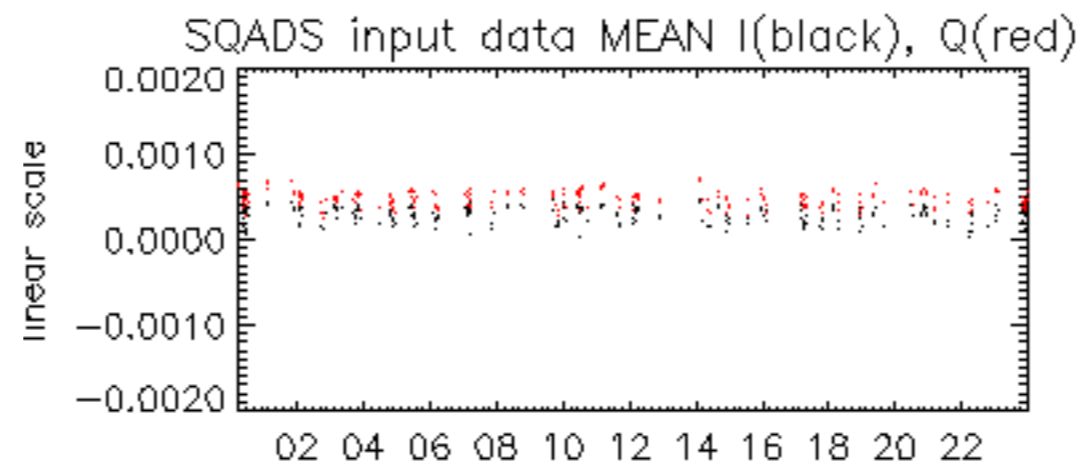


12-May

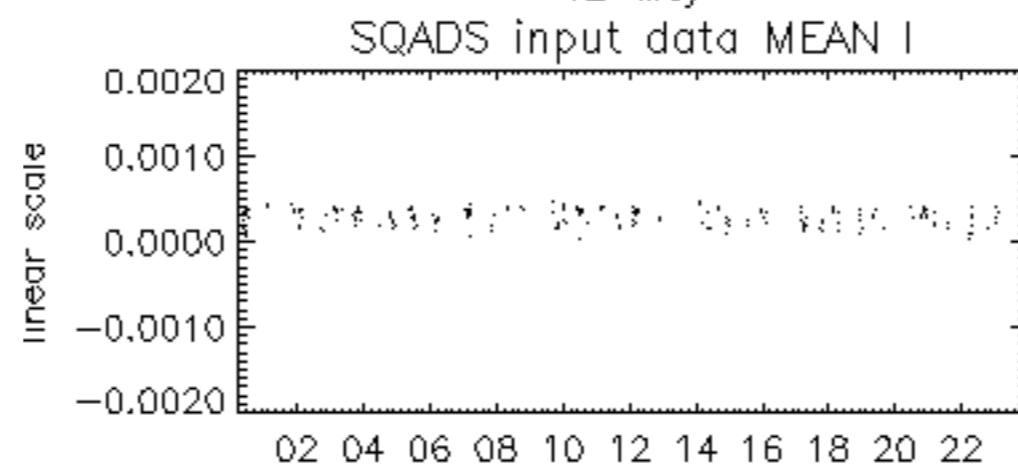


12-May

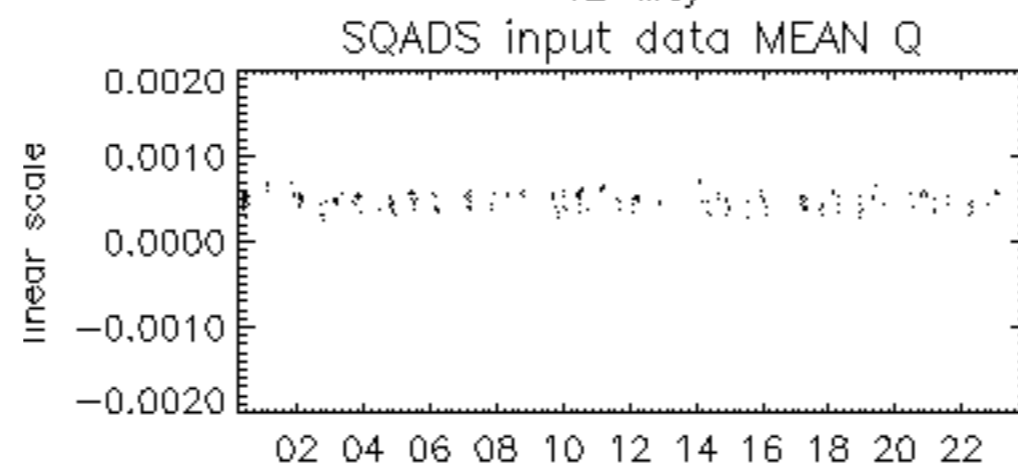


12-May

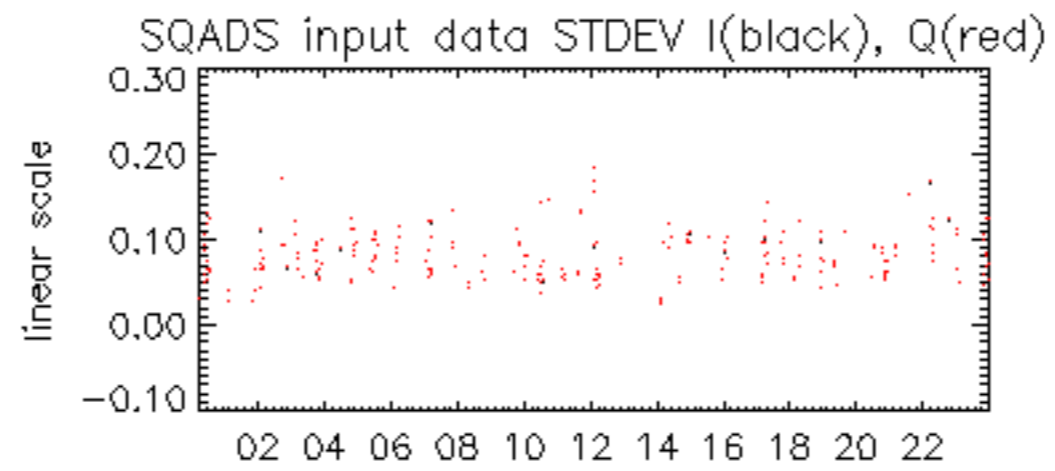


12-May



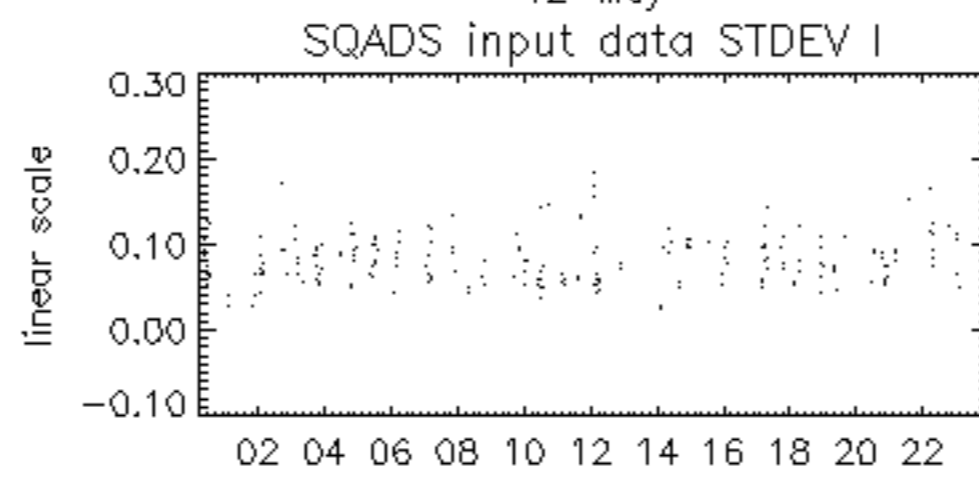


12-May



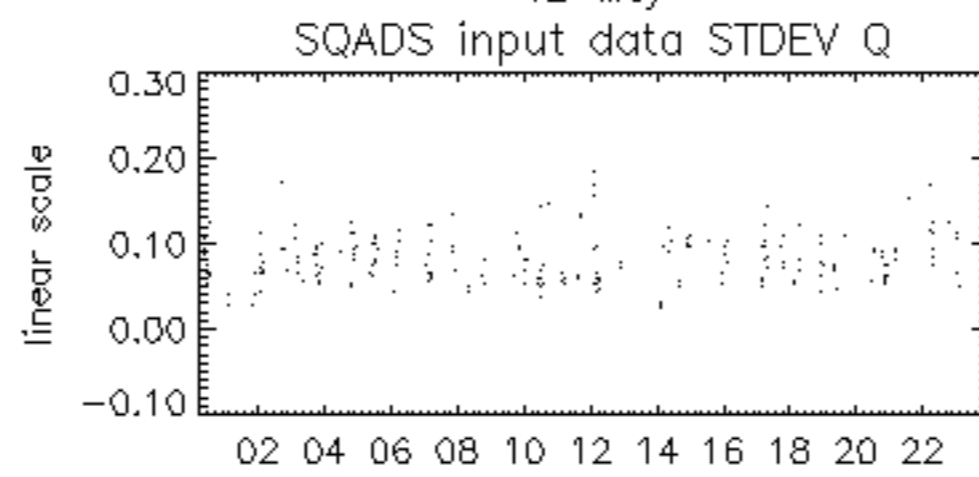


12-May

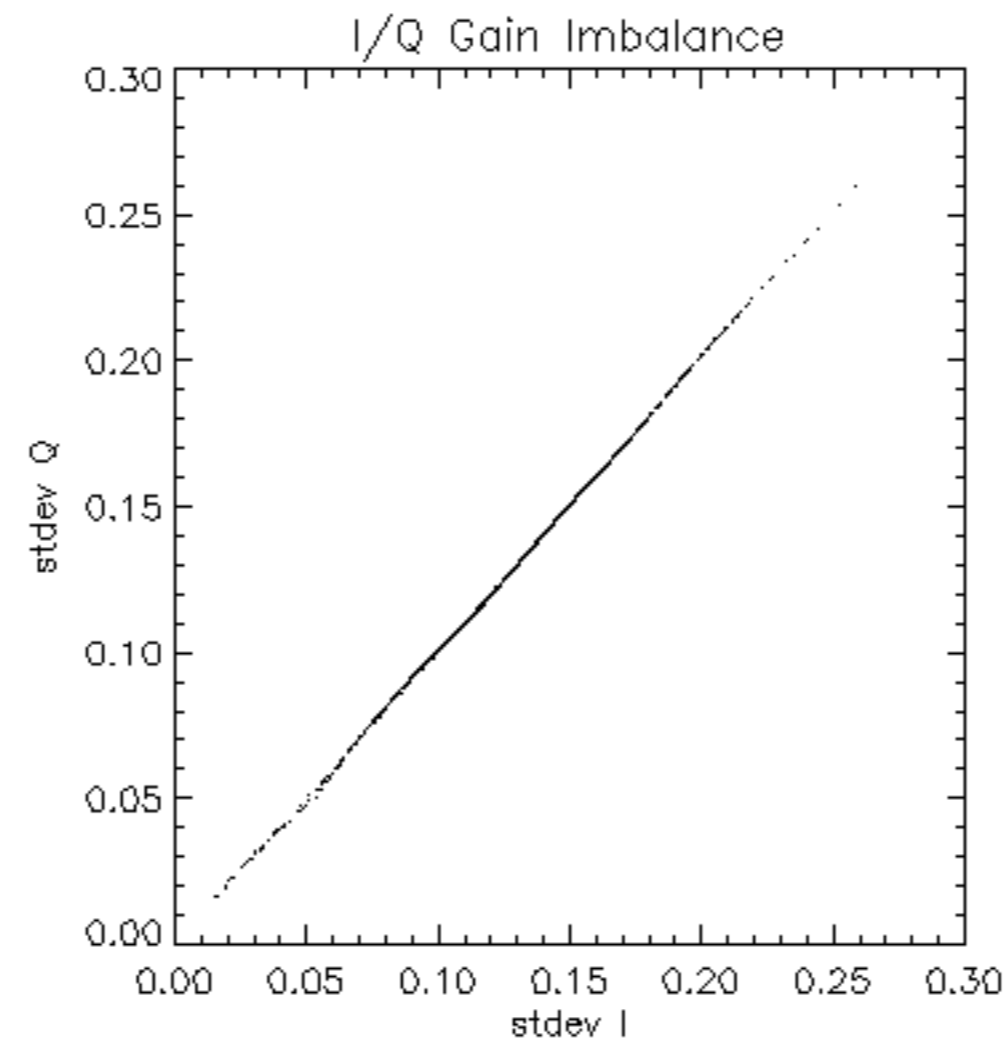

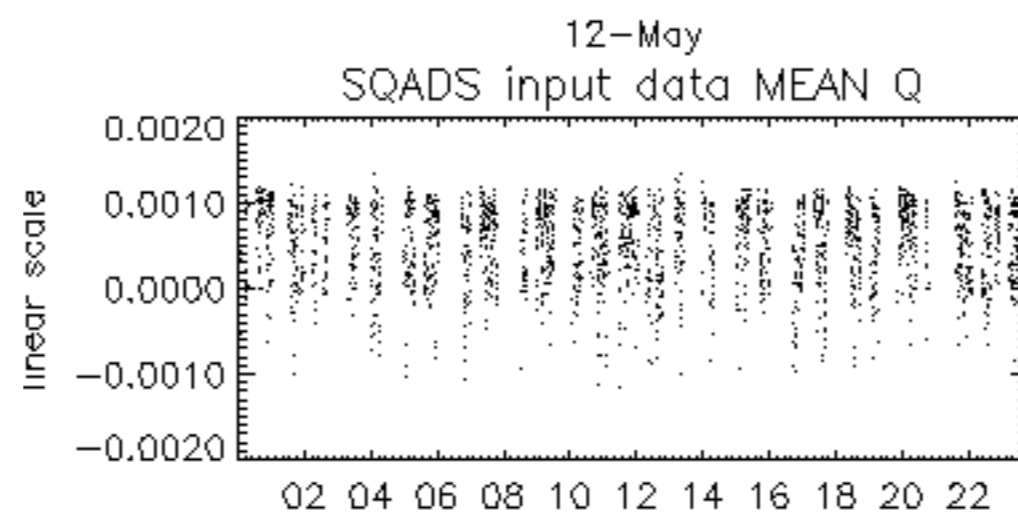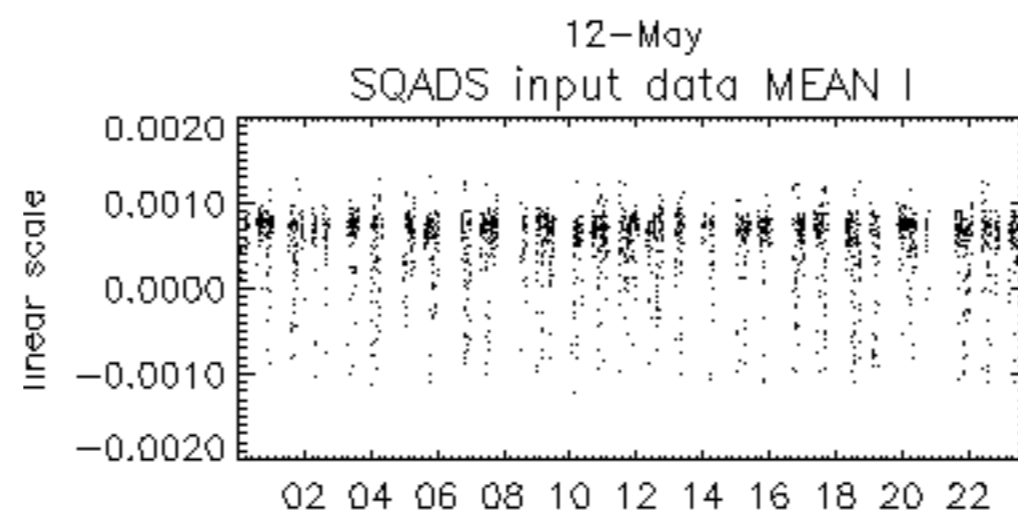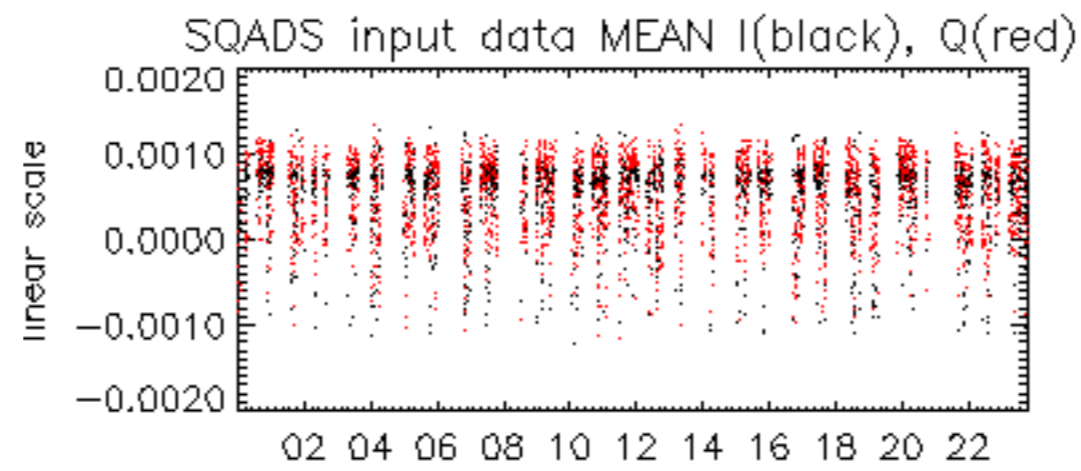

12-May

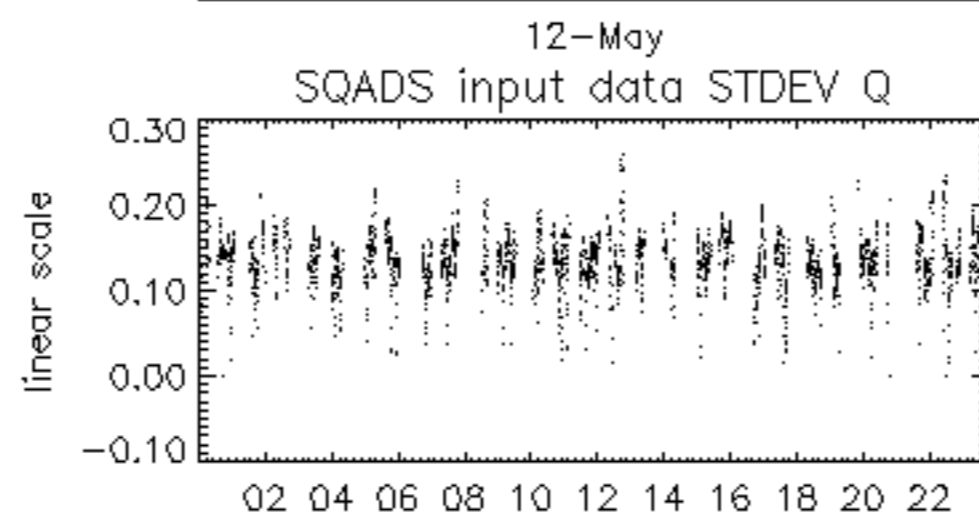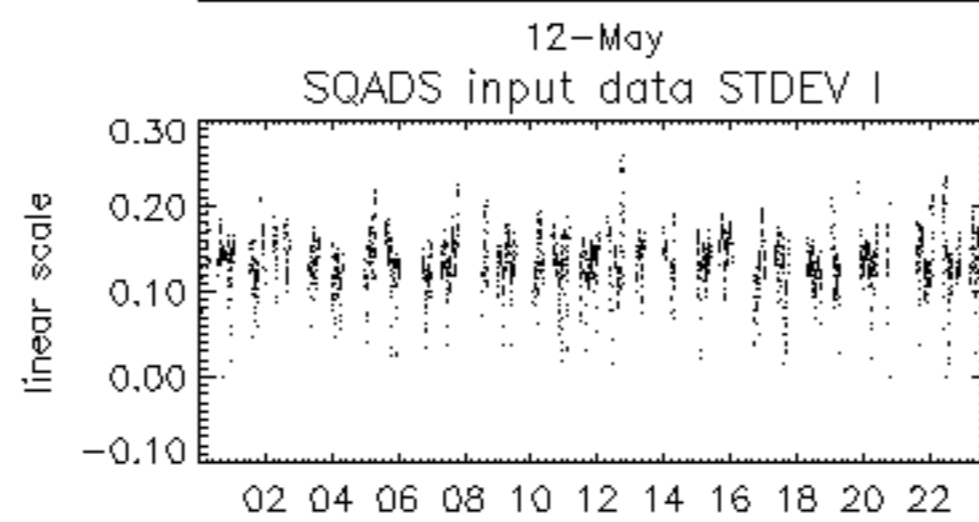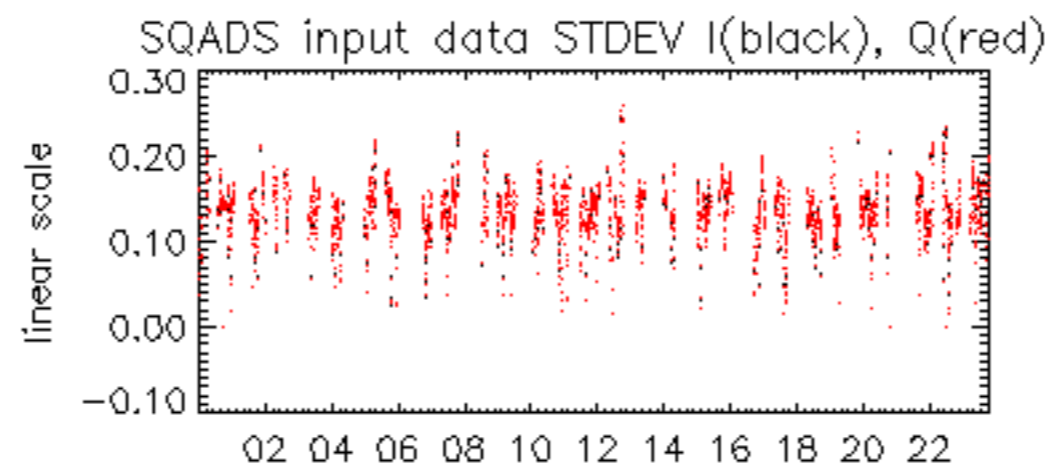

12-May

