



ASAR Daily Report



Analysis from 21-MAY-2009 00:00:00 to 21-MAY-2009 23:59:59. Page generated on 22-MAY-2009 07:44:22.
View log file: ASAR_Daily_Report_20090522_0730.log. For any anomalies please contact mtranfaglia@serco.it, Emma.Griffiths@vega.co.uk.

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

SUMMARY

1. DATA SUMMARY
 - 1.1 Summary tables
 - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
 - 2.1 IECF operational ADFs list
 - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
 - 3.1 V/V polarisation
 - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
 - 4.1 Analysis for WVS IS2 V/V
 - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
 - 4.1.2 All Rows Analysis for WVS IS2 V/V
 - 4.2 Analysis for GM1 SS3 H/H
 - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
 - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
 - 5.1 Analysis for WVS IS2 V/V
 - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
 - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
 - 5.2 Analysis for GM1 SS1 H/H
 - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
 - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
 - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
 - 6.1 Analysis for WSM SS1 H/H
 - 6.1.1 ScaleFactor
 - 6.2 Analysis for WSM SS1 V/V
 - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
 - 7.1 Analysis for WVS
 - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
 - 8.1 Number of Missing Lines
 - 8.2 Number of Gaps

1 - DATA SUMMARY

1.1 - Summary tables

[[BACK TO MENU](#)]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	1	PDE	WS	H/H	32	PDE	IS1	H/H	2	PDE	IS2	***	1	PDE	WS	H/H	58	PDK	2009-05-21 07:47:09	V	320
PDE	IS2	V/V	27	PDK	WS	H/H	46	PDE	IS2	H/H	1	PDE	IS2	H/H	18	PDE	WS	V/V	23				
PDK	IS2	V/V	25					PDK	IS6	H/H	1	PDE	IS2	V/V	10	PDK	WS	H/H	15				
												PDE	IS3	V/V	1	PDK	WS	V/V	1				
												PDE	IS4	H/H	2								
												PDE	IS5	H/H	1								
												PDE	IS6	V/V	3								
												PDE	IS7	V/V	2								
												PDK	IS2	H/H	1								
												PDK	IS2	V/V	2								
												PDK	IS4	V/V	1								

1.2 - Lists of products used

[[BACK TO MENU](#)]

[[TXT](#)] [[XLS](#)] [List_WVS_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_GM1_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_APM_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_IMM_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_WSM_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_MS_products_used](#)

2 - AUXILIARY FILES ANALYSIS

2.1 - IECF operational ADFs list

[[BACK TO MENU](#)]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20081215_141339_20070204_165113_20091231_000000
ASA_INS_AXVIEC20081215_140905_20070307_060000_20091231_000000
ASA_XCH_AXVIEC20081215_143642_20020301_000000_20091231_000000
ASA_XCA_AXVIEC20090311_104501_20080801_000000_20091231_235959

2.2 - Products with wrong ADFs

[[BACK TO MENU](#)]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0



[[TXT](#)] [[XLS](#)] [Check_ADFs_WVS](#)
 [[TXT](#)] [[XLS](#)] [Check_ADFs_GM1](#)






3.2 - H/H polarisation

[[BACK TO MENU](#)]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
After antenna maintenance (2005-09-22/23)	Previous product in the same polarisation

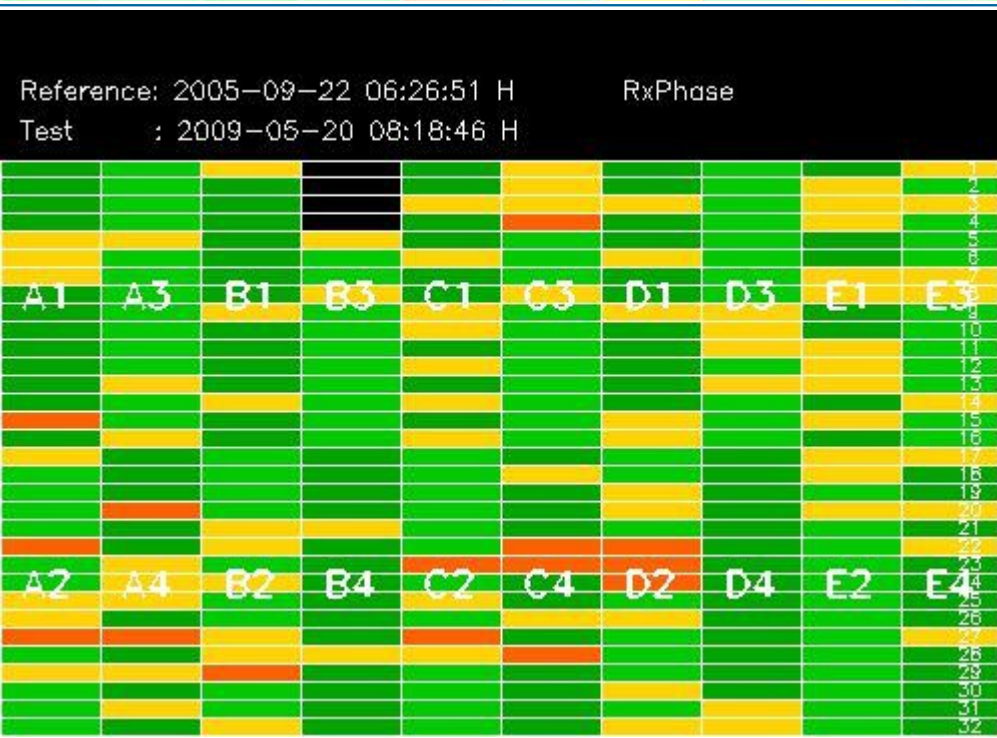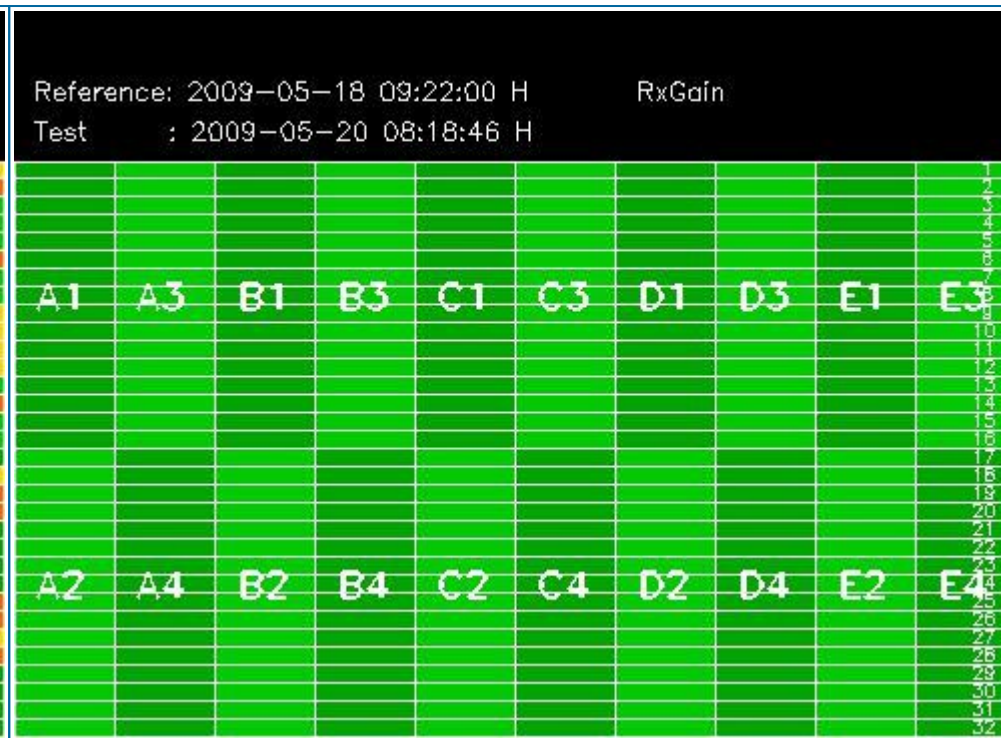

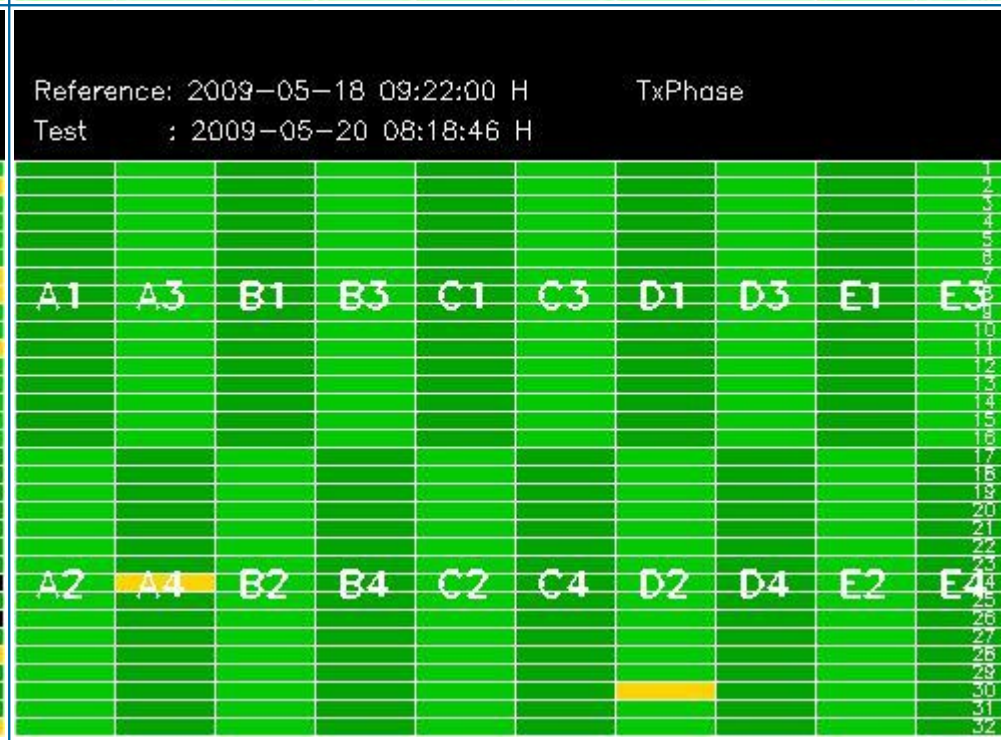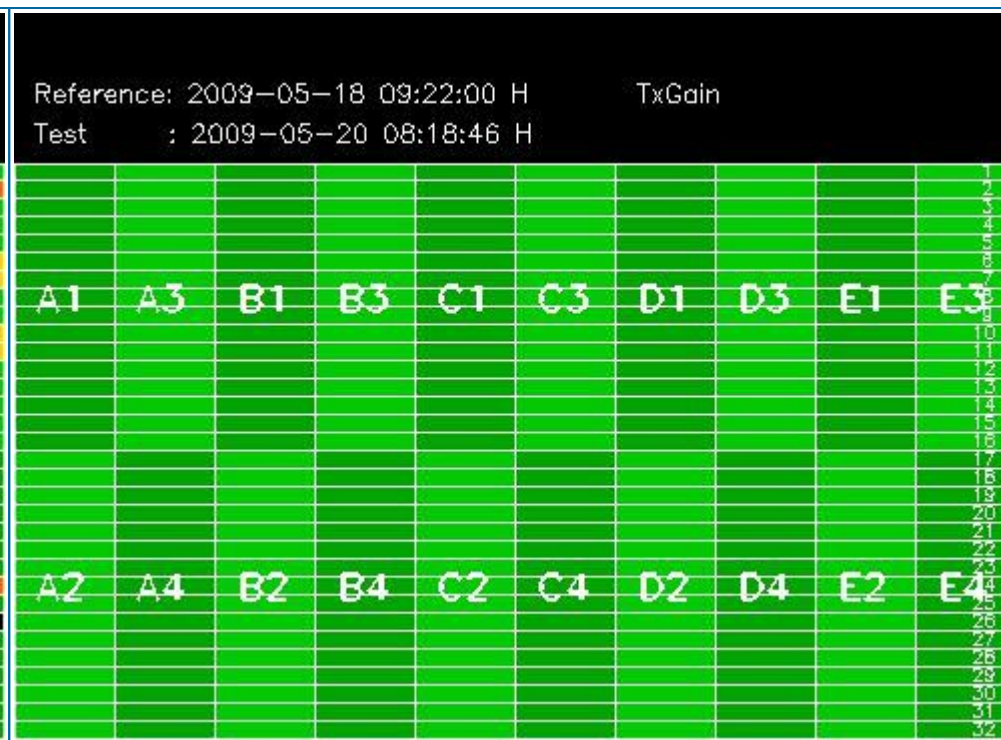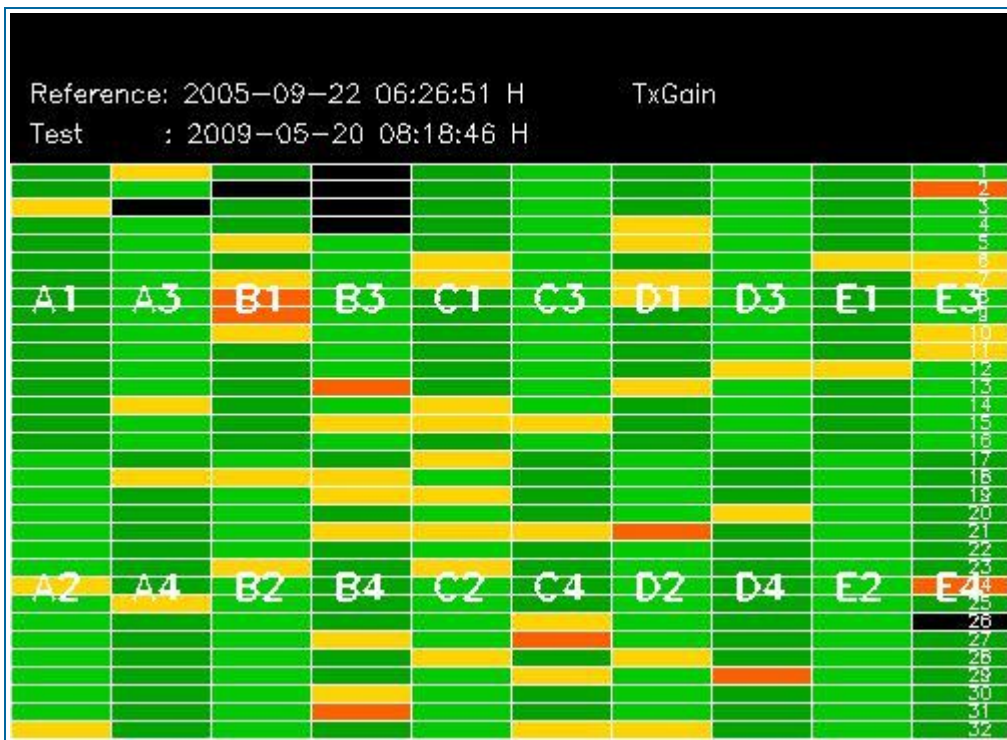

4 - CALIBRATION PULSES ANALYSIS

4.1 - Analysis for WVS IS2 V/V


4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for WVS IS2 V/V

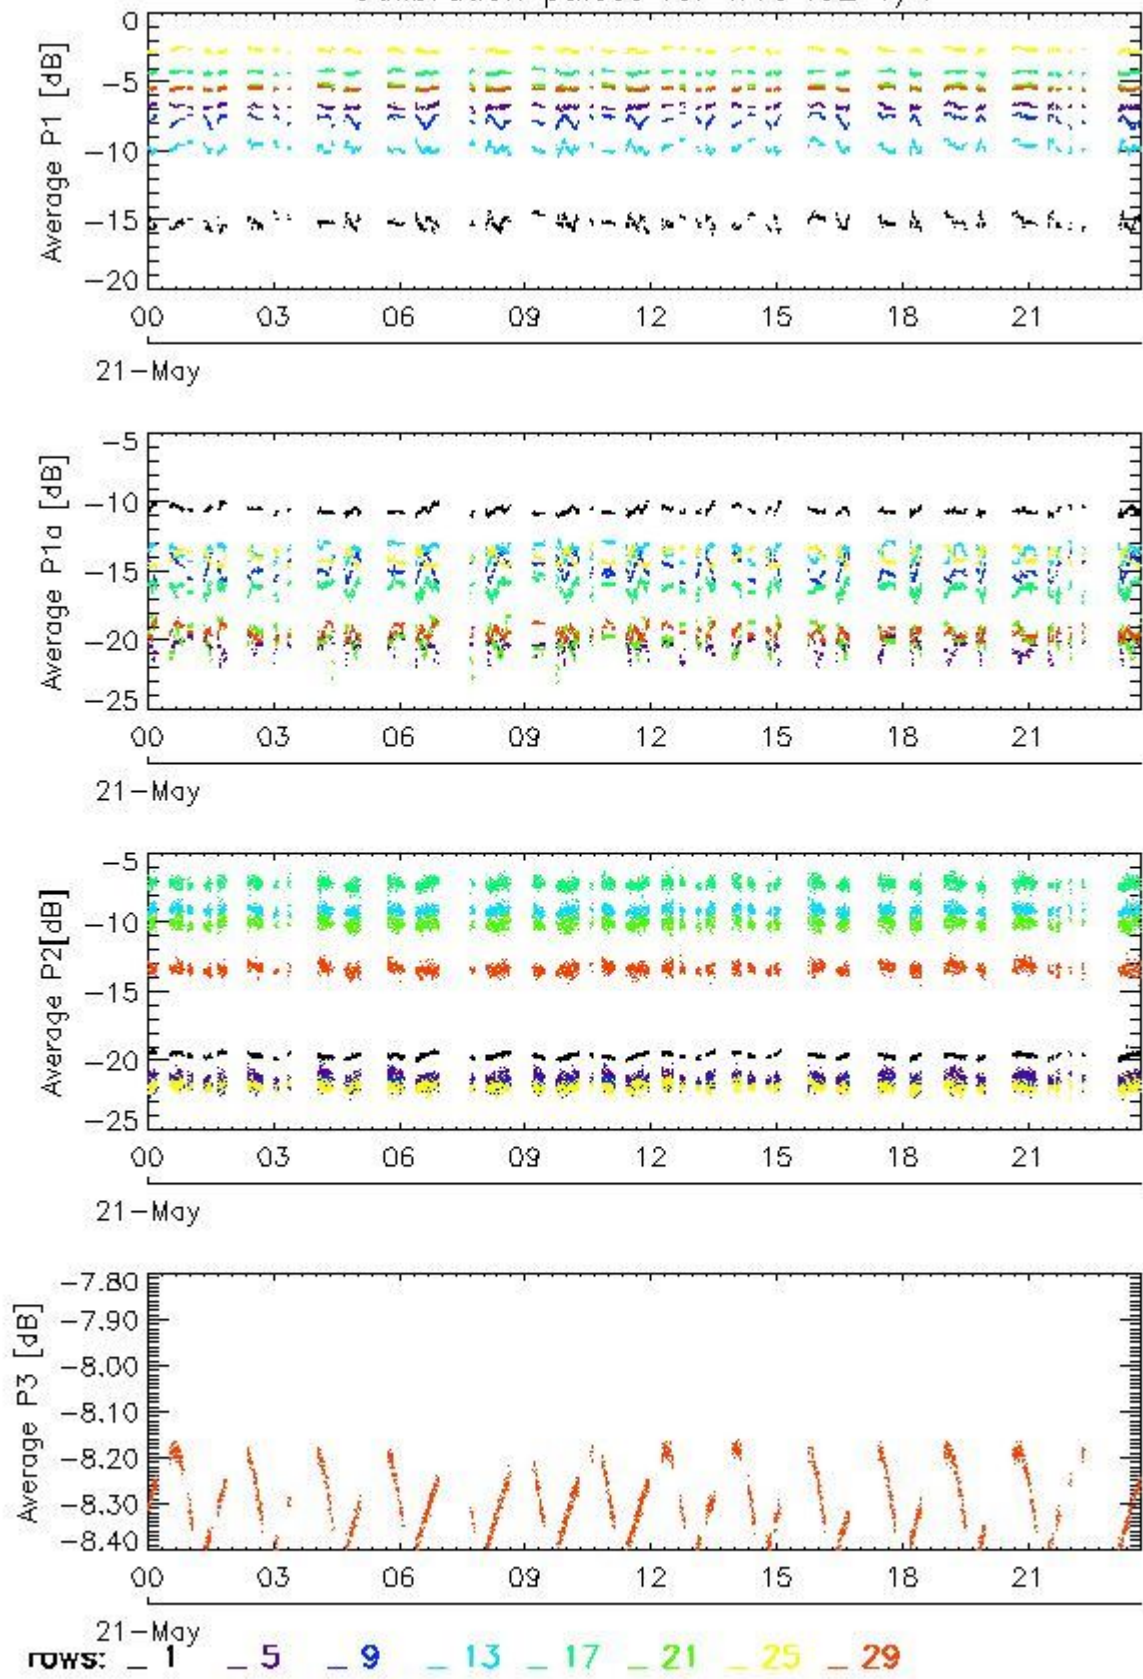


Transmit power (P1 - P1a) for WVS IS2 V/V

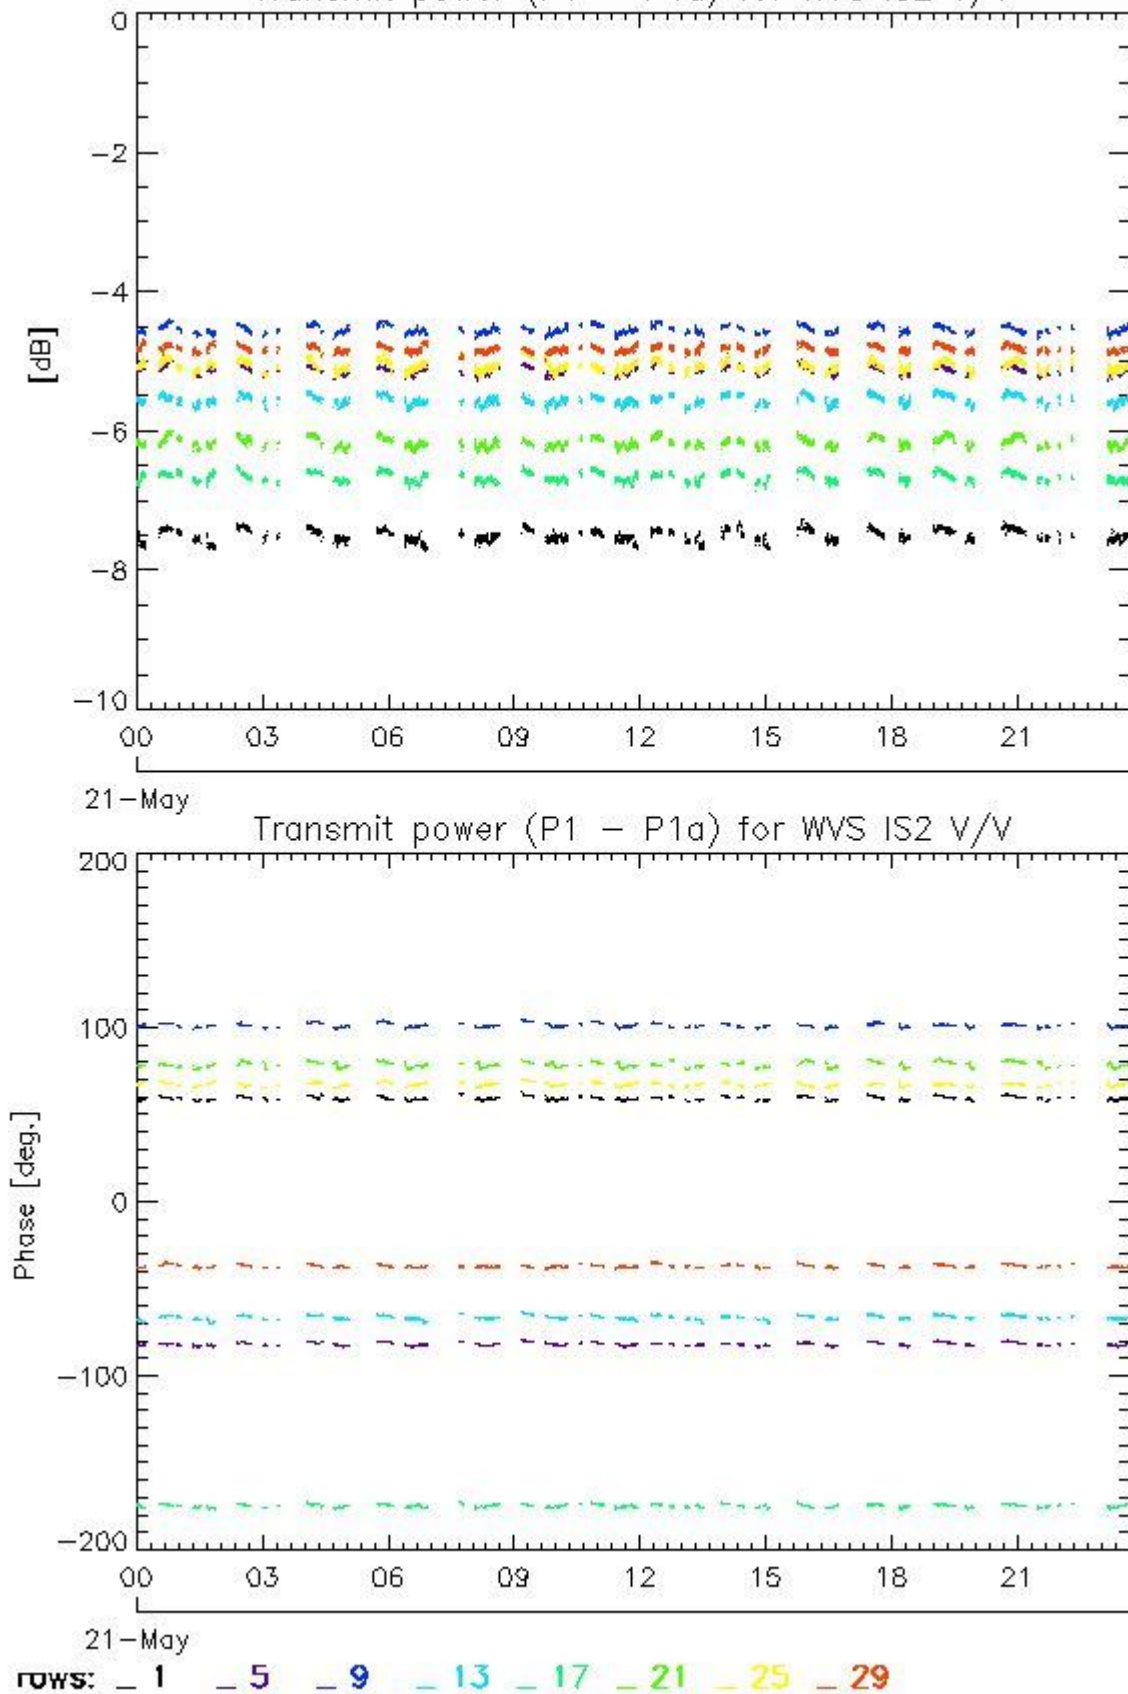

4.1.2 - All Rows Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



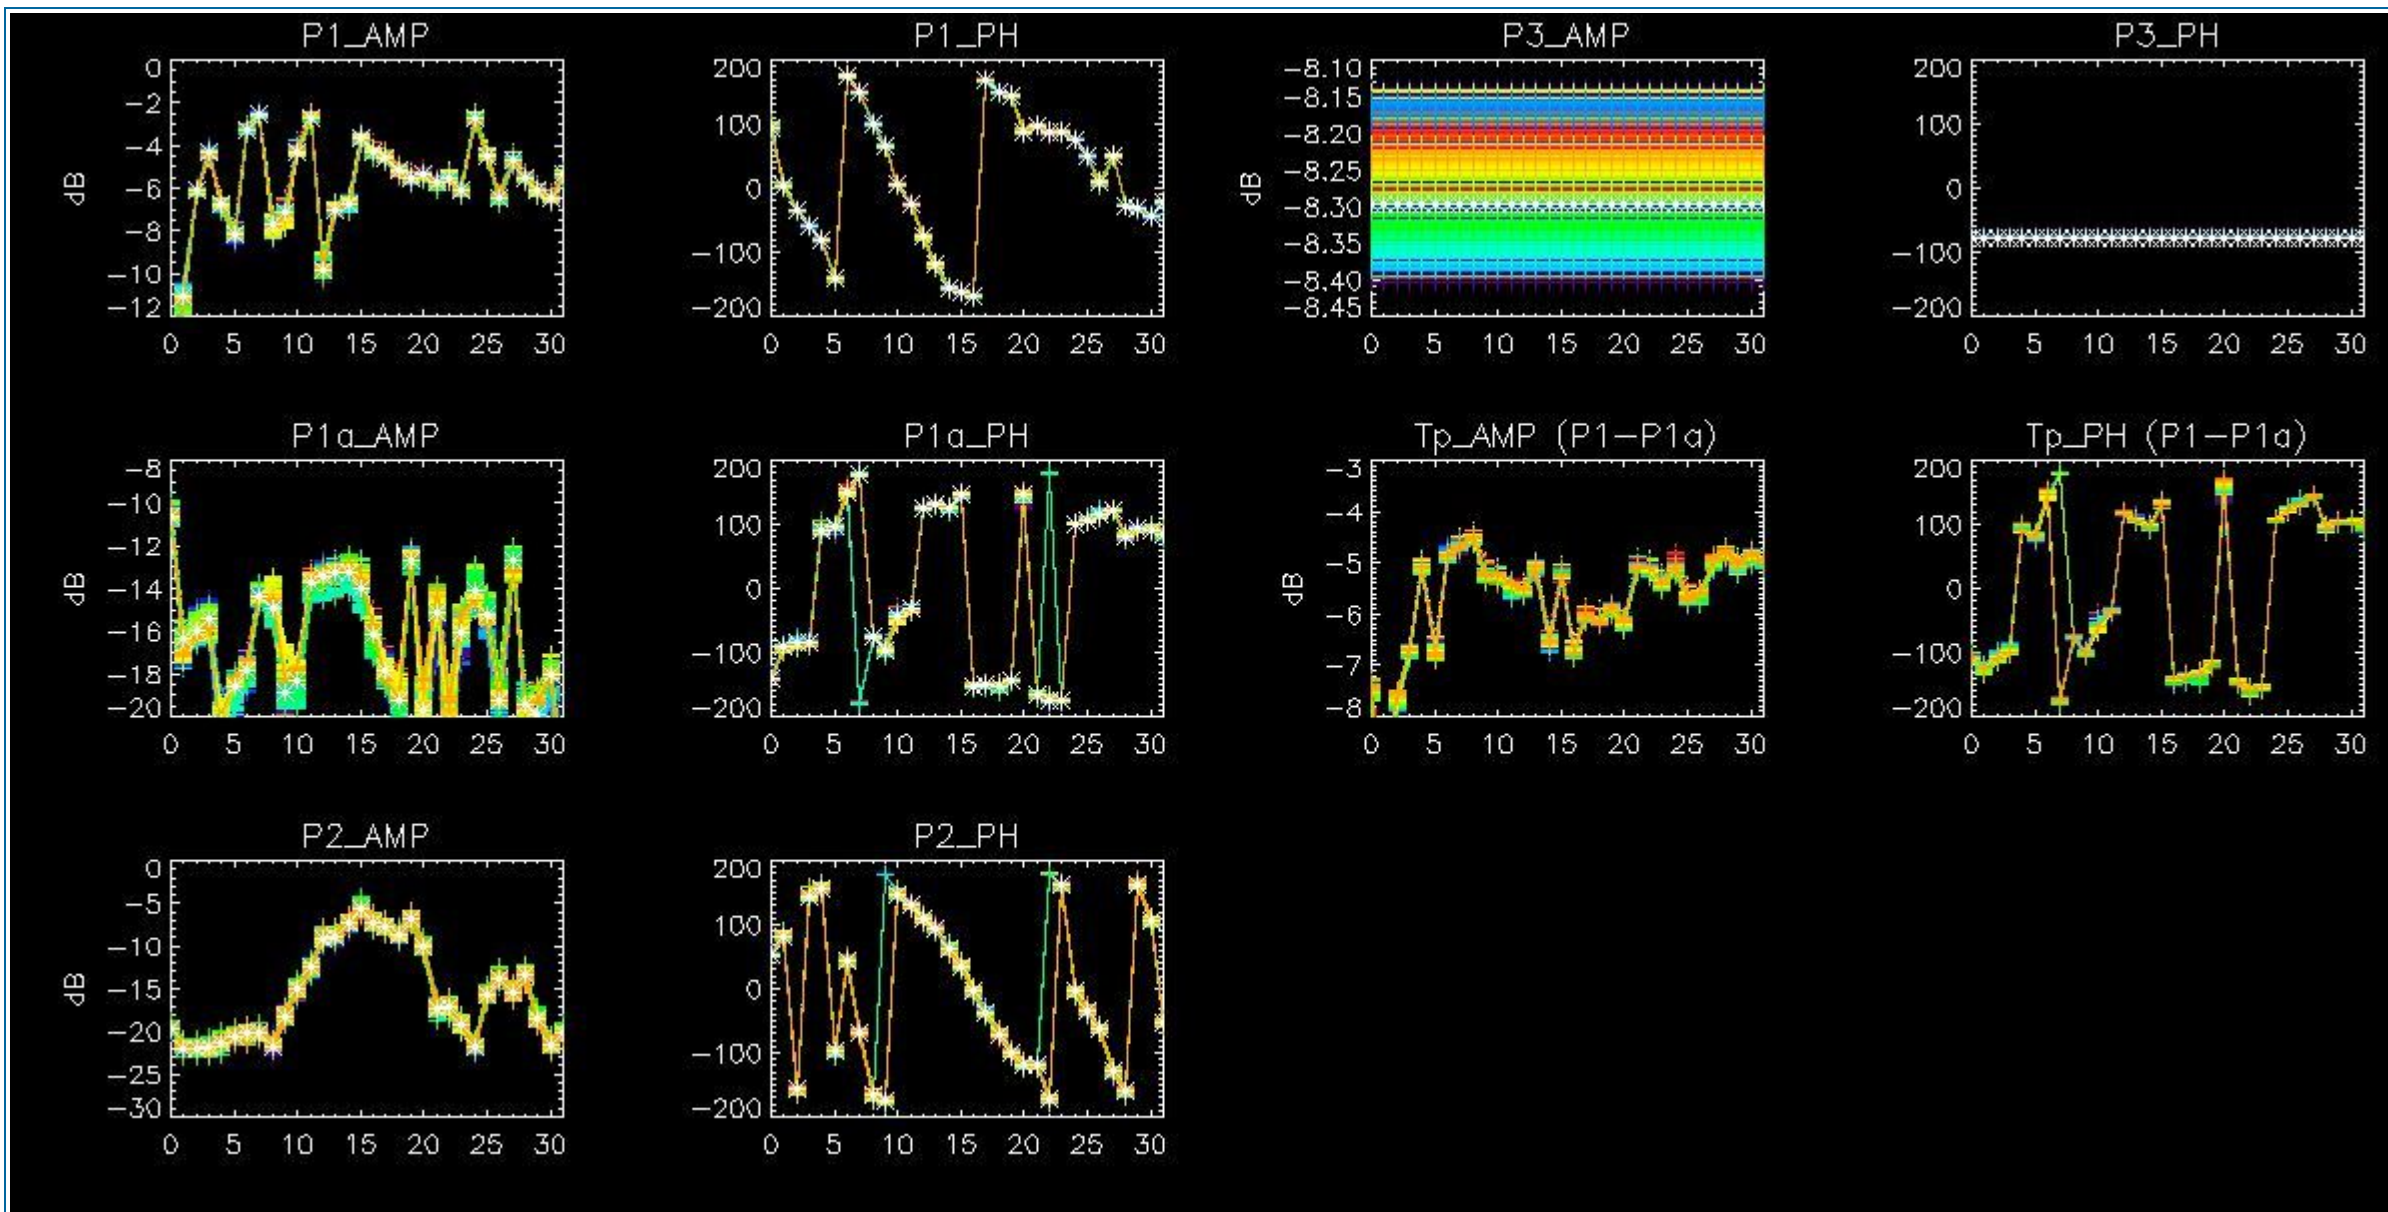

4.2 - Analysis for GM1 SS3 H/H


4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]


Calibration pulses for GM1 SS3 H/H

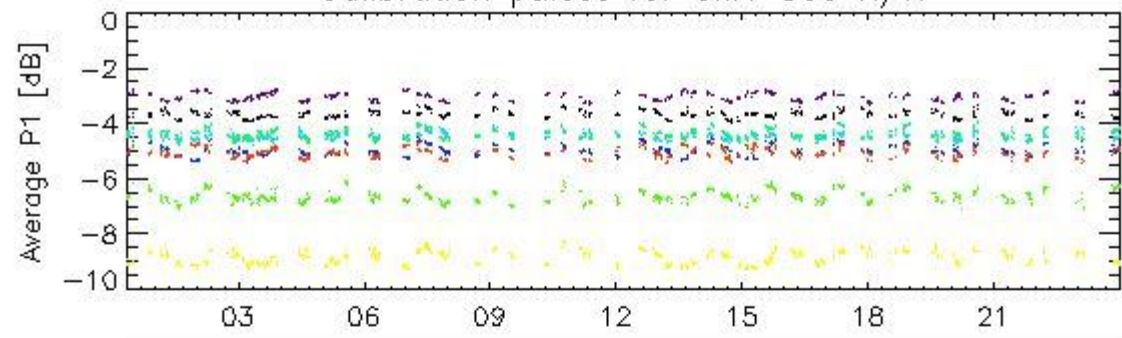


21-May

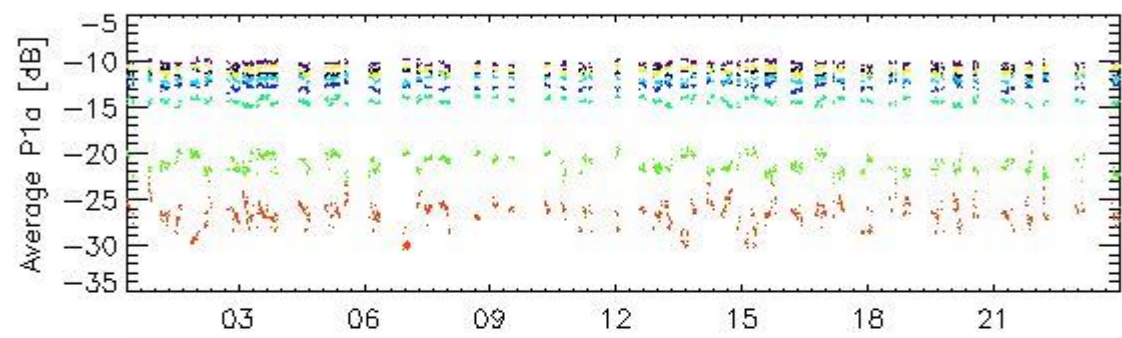

21-May

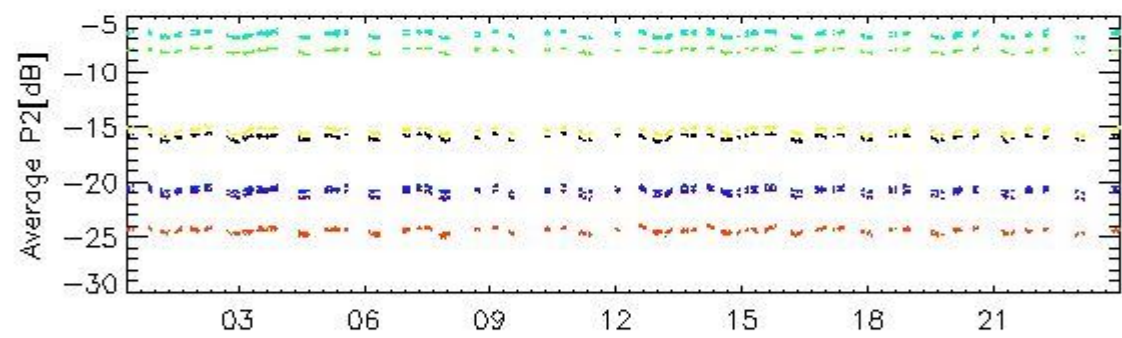


21-May

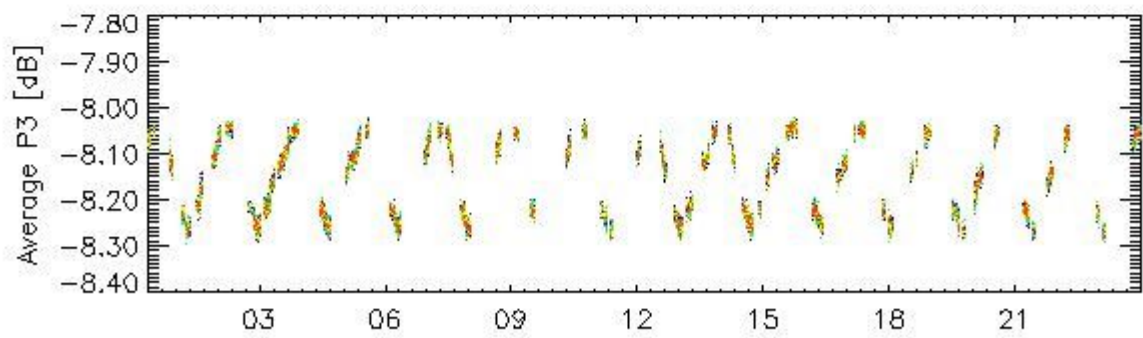

21-May


rows: _ 1 _ 5 _ 9 _ 13 _ 17 _ 21 _ 25 _ 29

Transmit power (P1 - P1a) for GM1 SS3 H/H

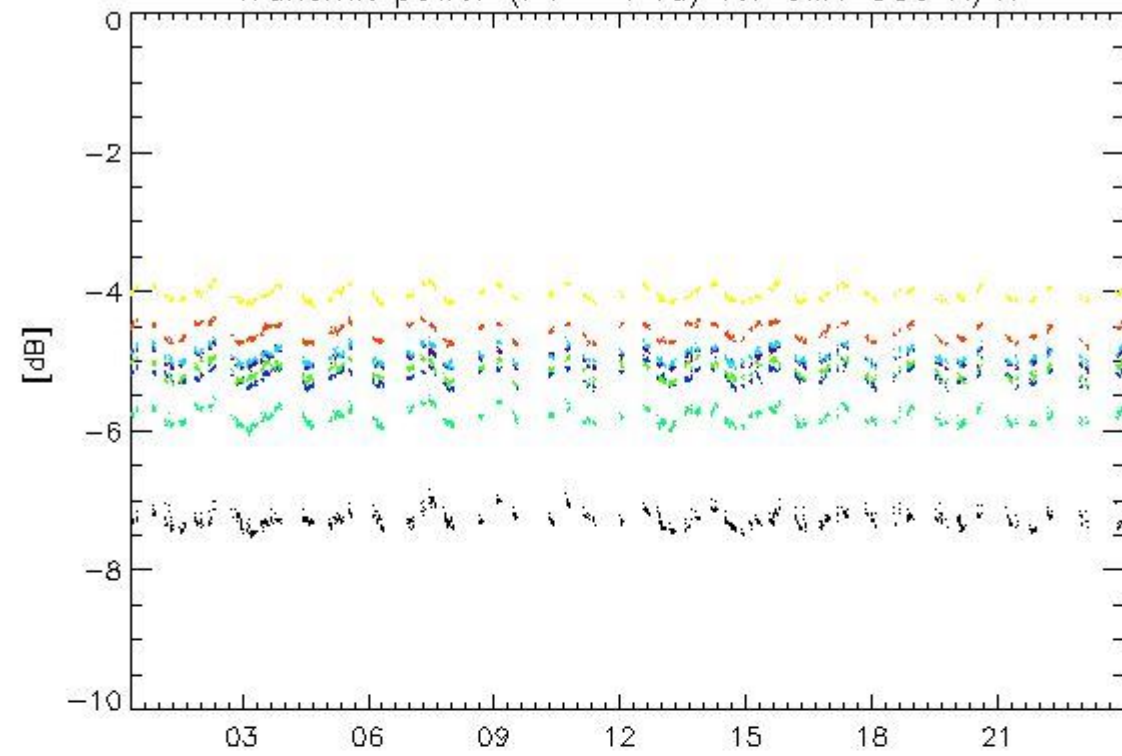

21-May

Transmit power (P1 - P1a) for GM1 SS3 H/H

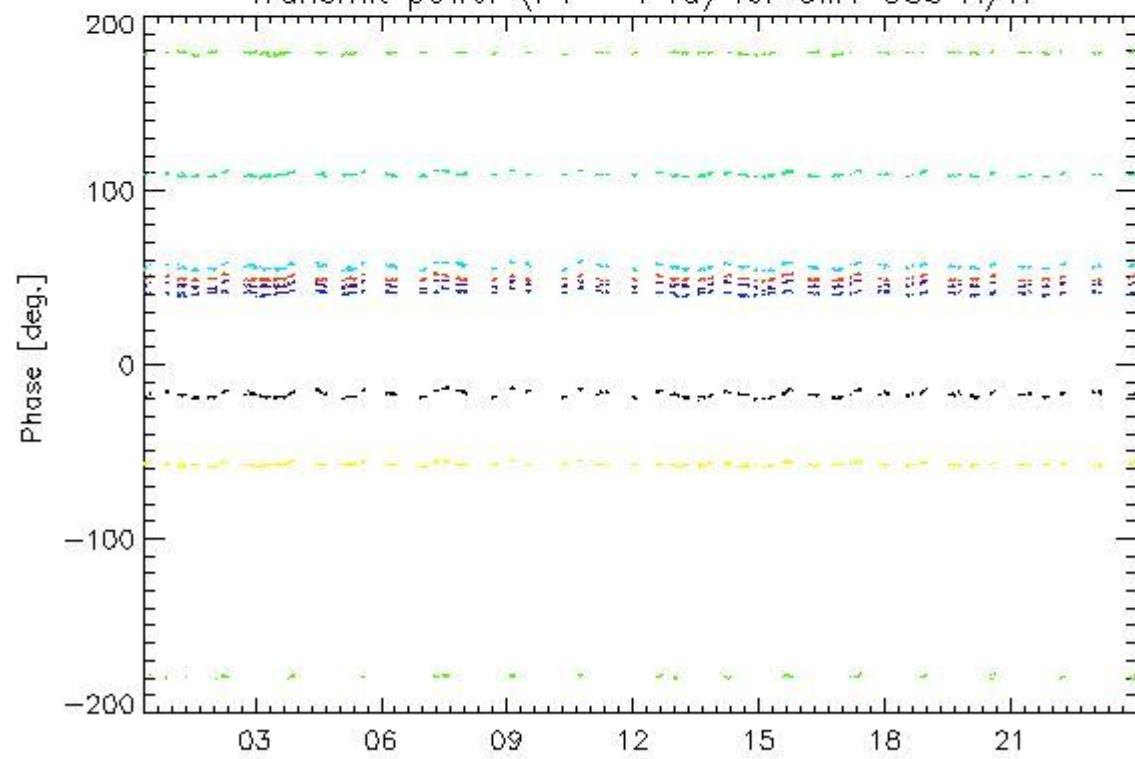


21-May

rows: _ 1 _ 5 _ 9 _ 13 _ 17 _ 21 _ 25 _ 29

4.2.2 - All Rows Analysis for GM1 SS3 H/H

[[BACK TO MENU](#)]



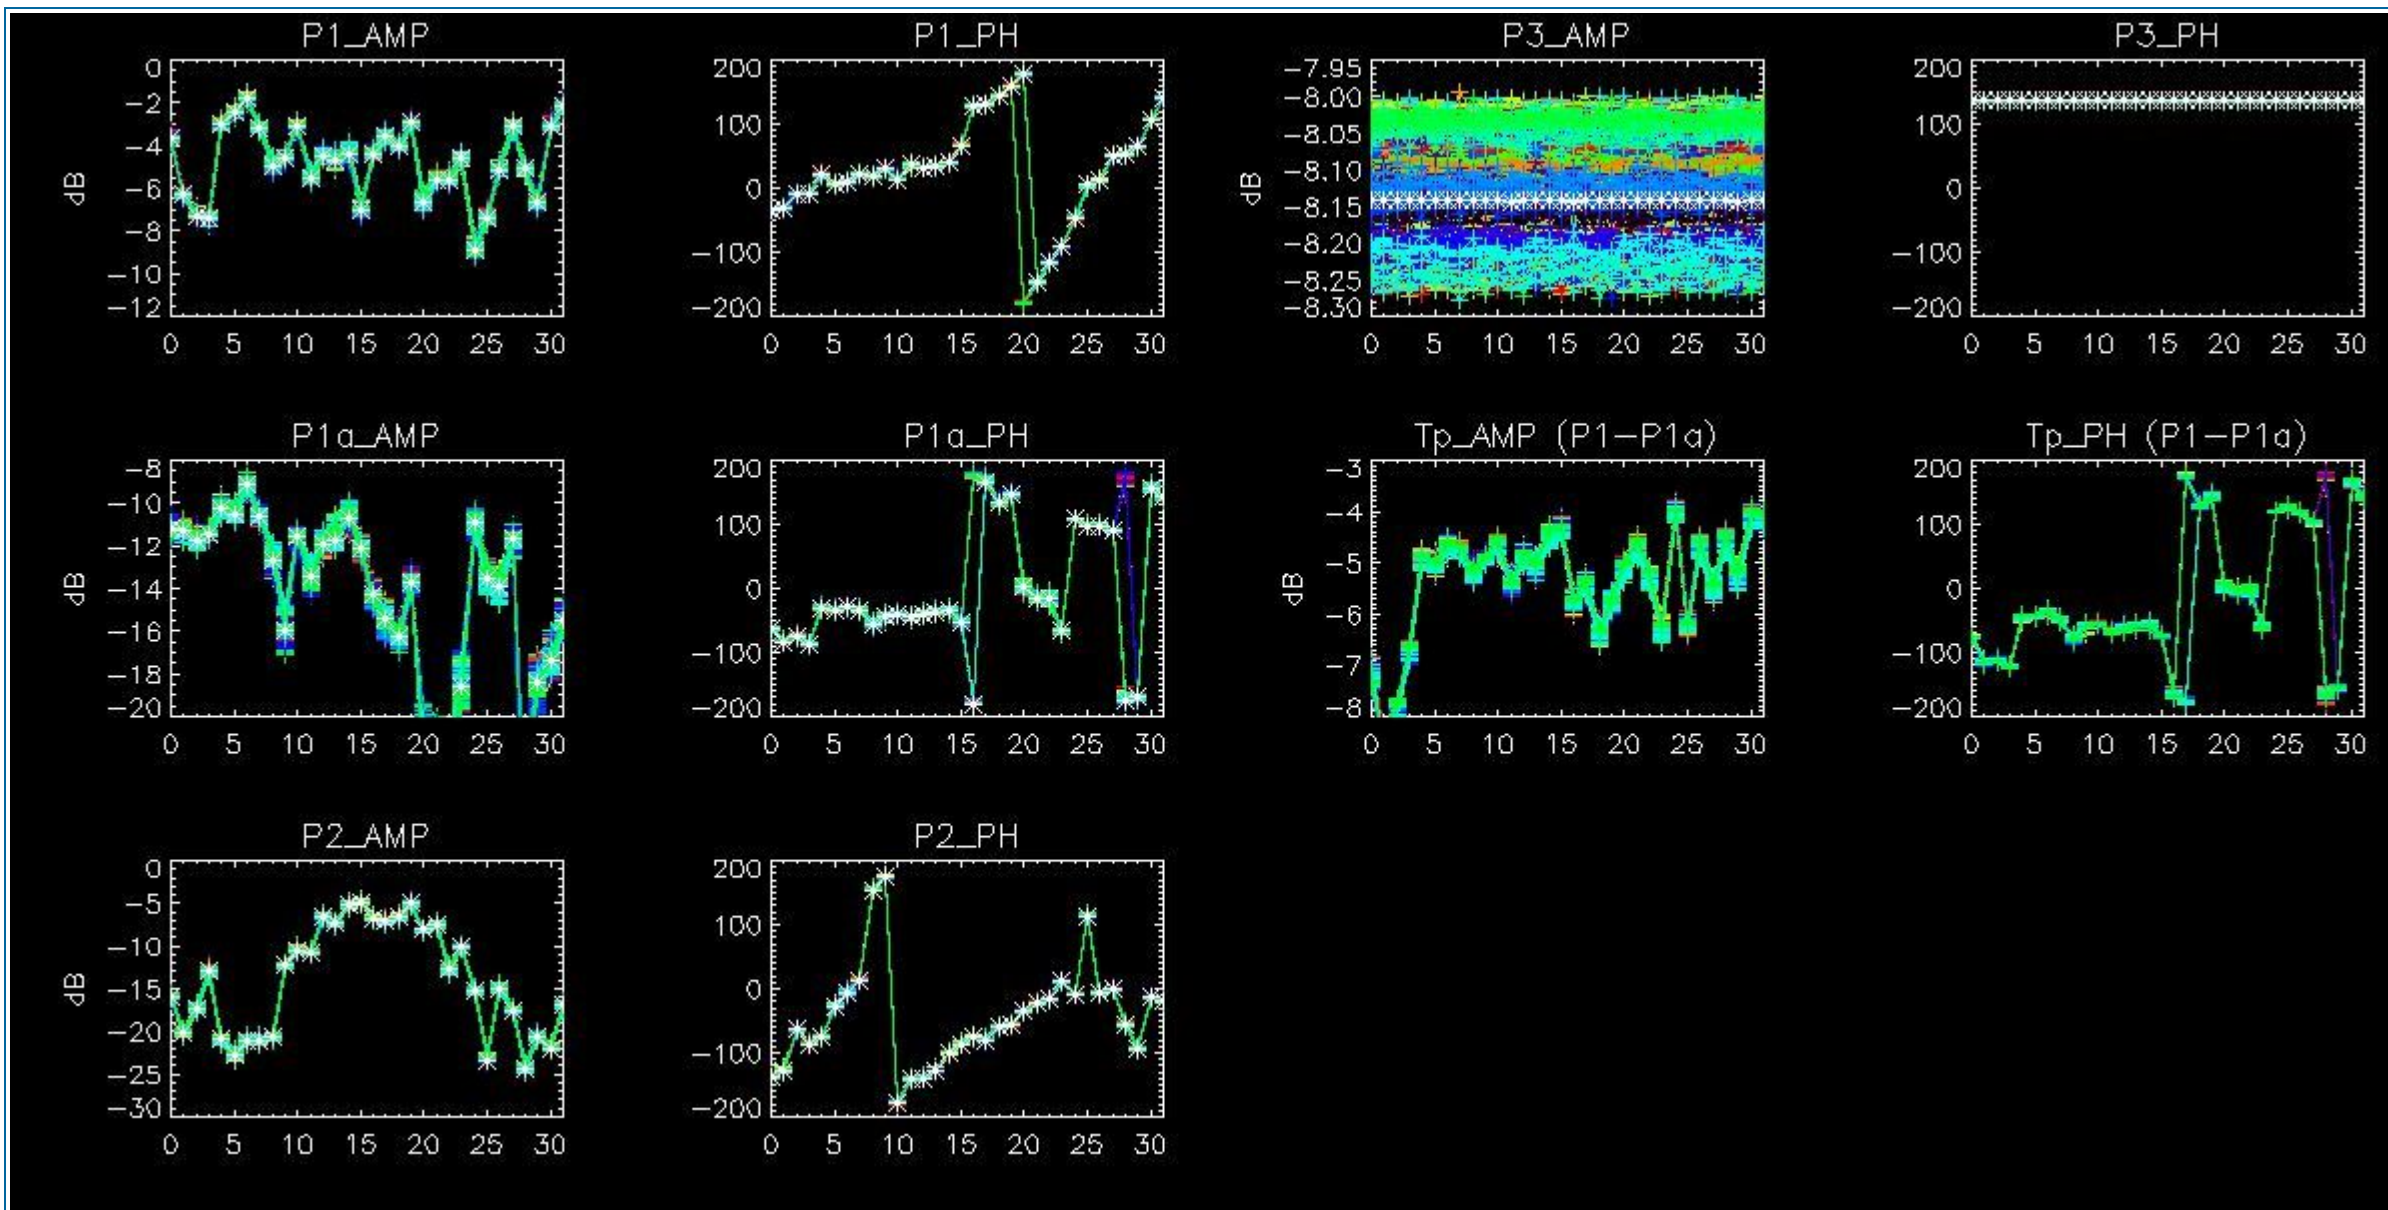


5 - DOPPLER ANALYSIS

5.1 - Analysis for WVS IS2 V/V

5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]




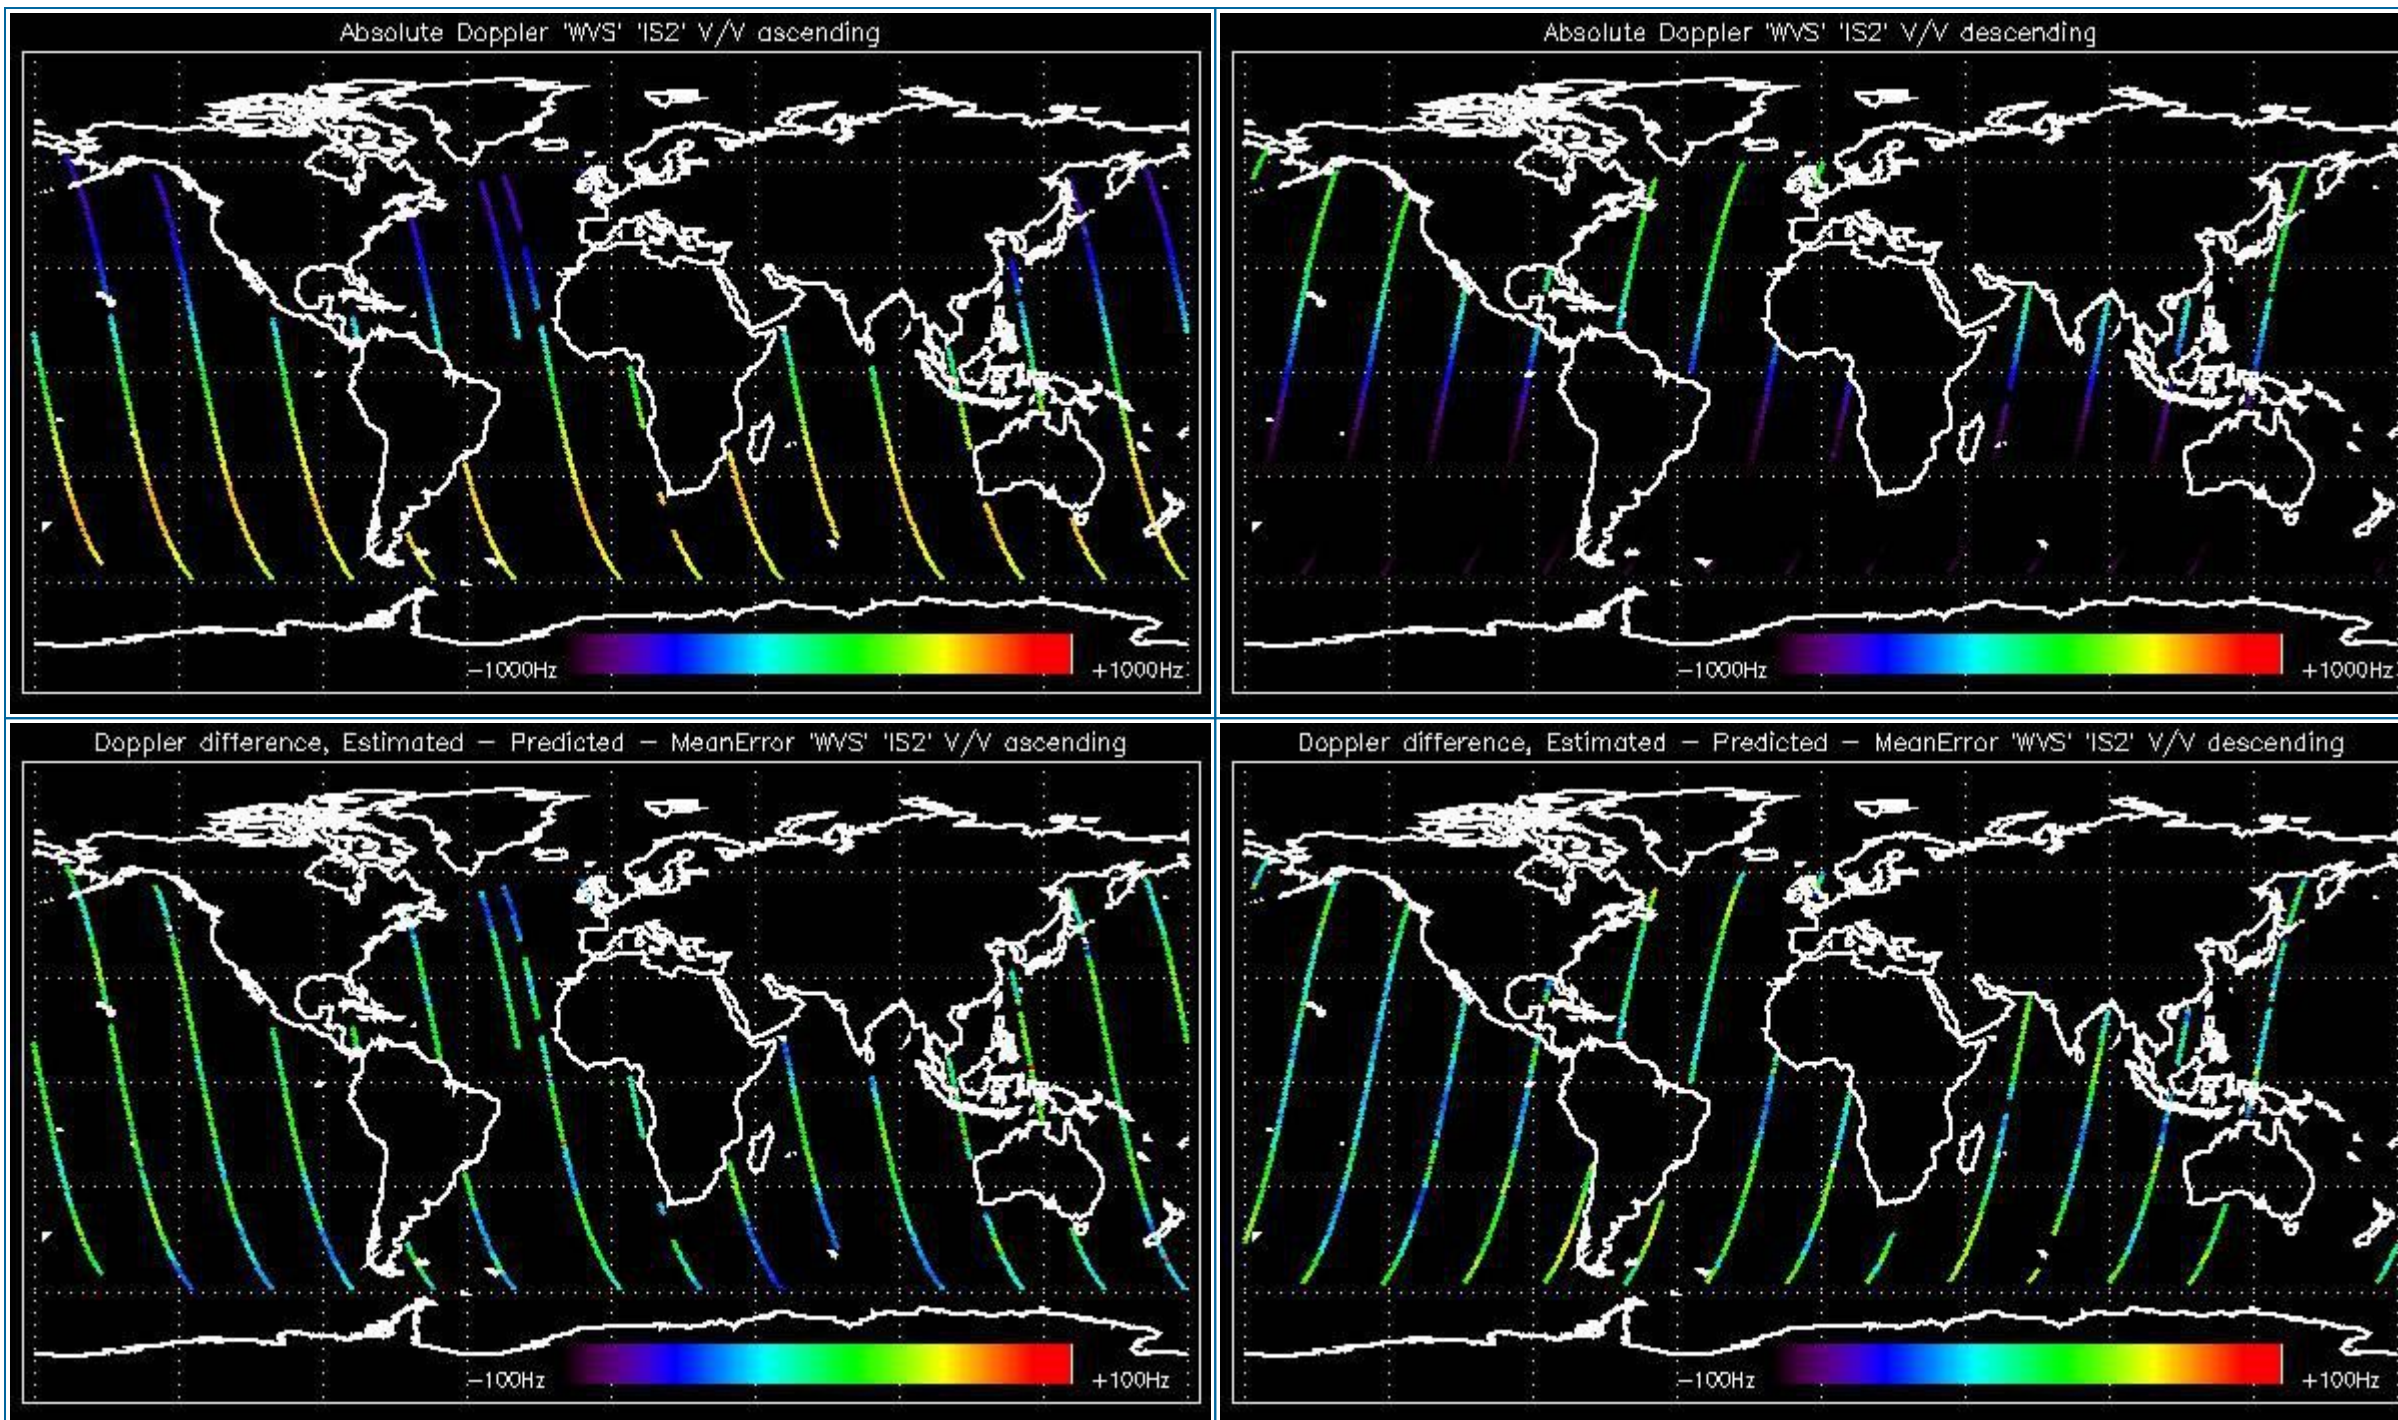

5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



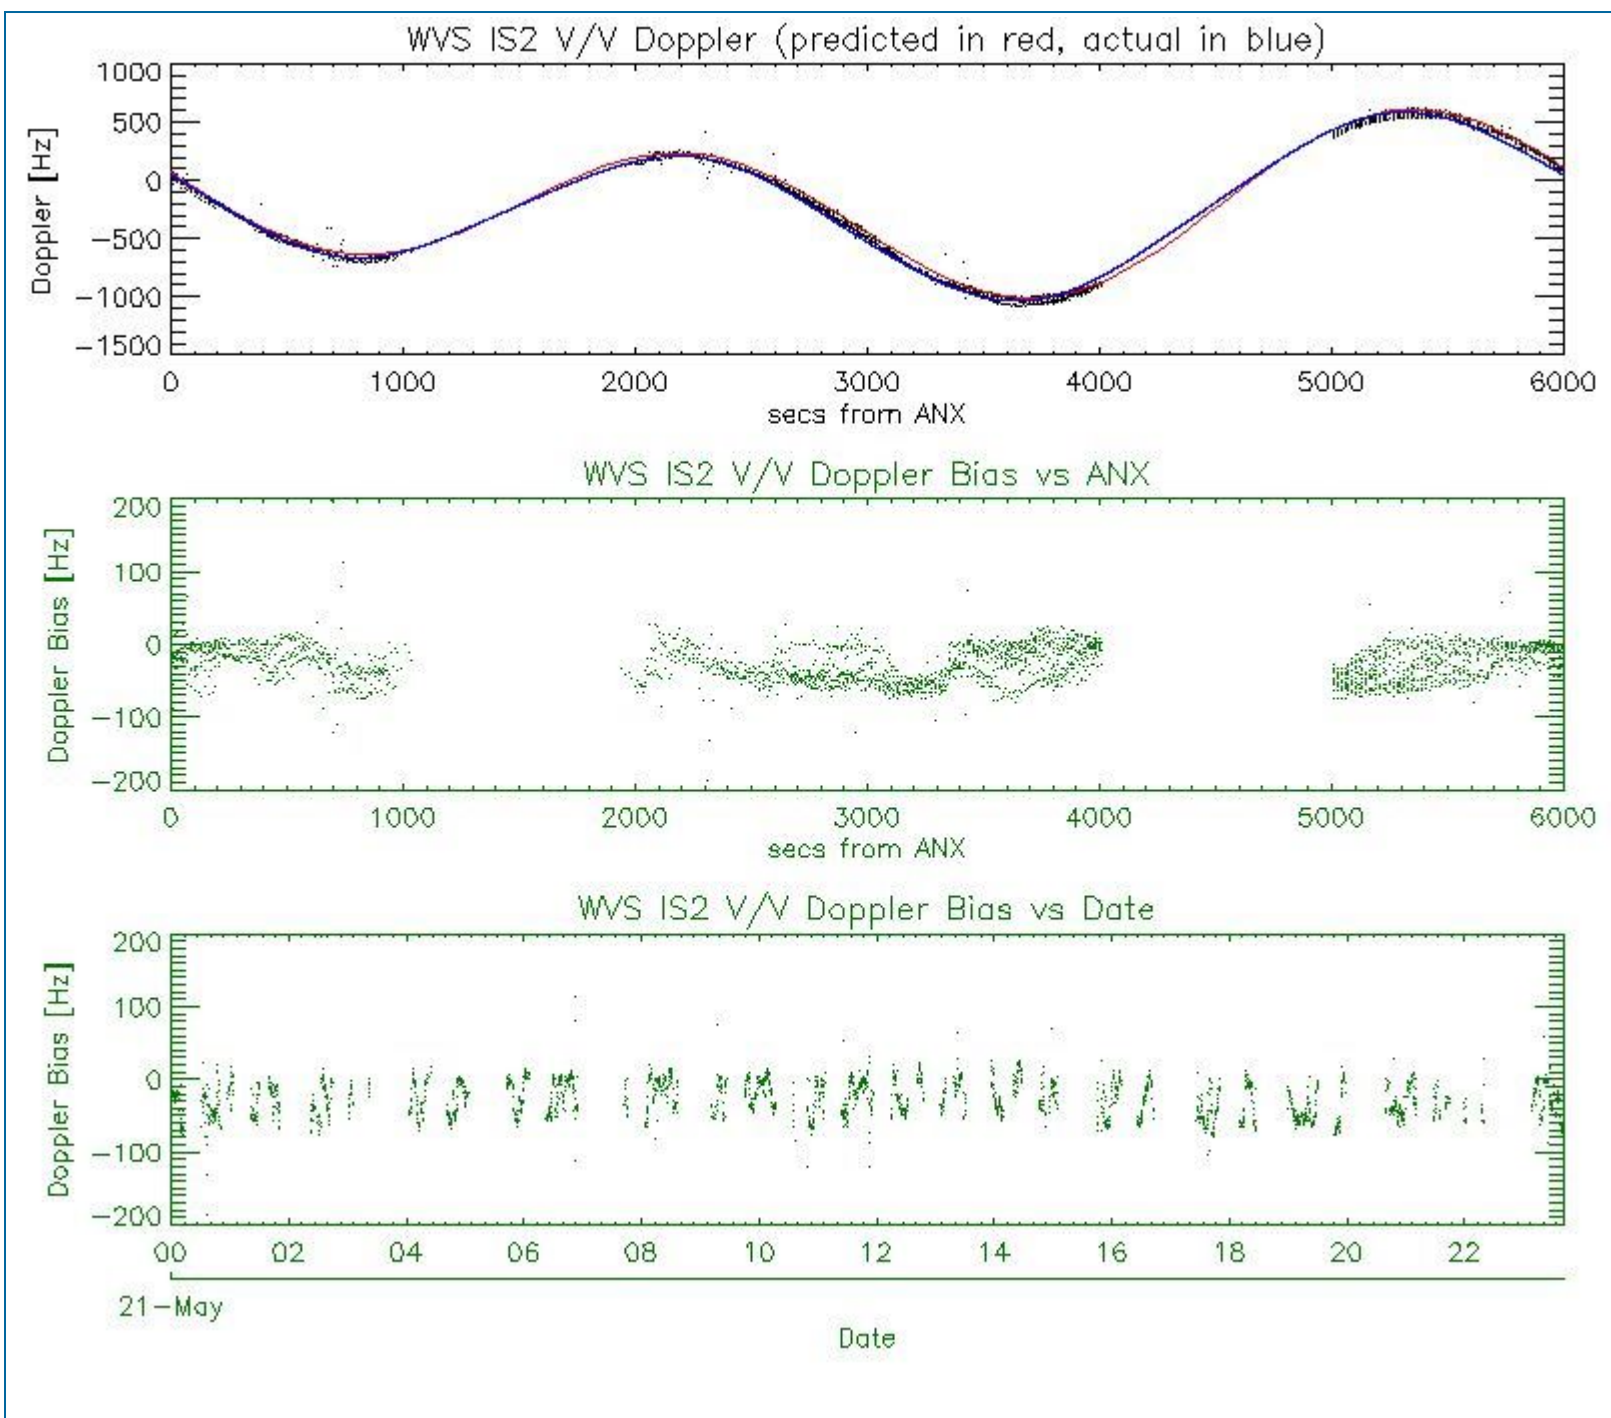


5.2 - Analysis for GM1 SS1 H/H

5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




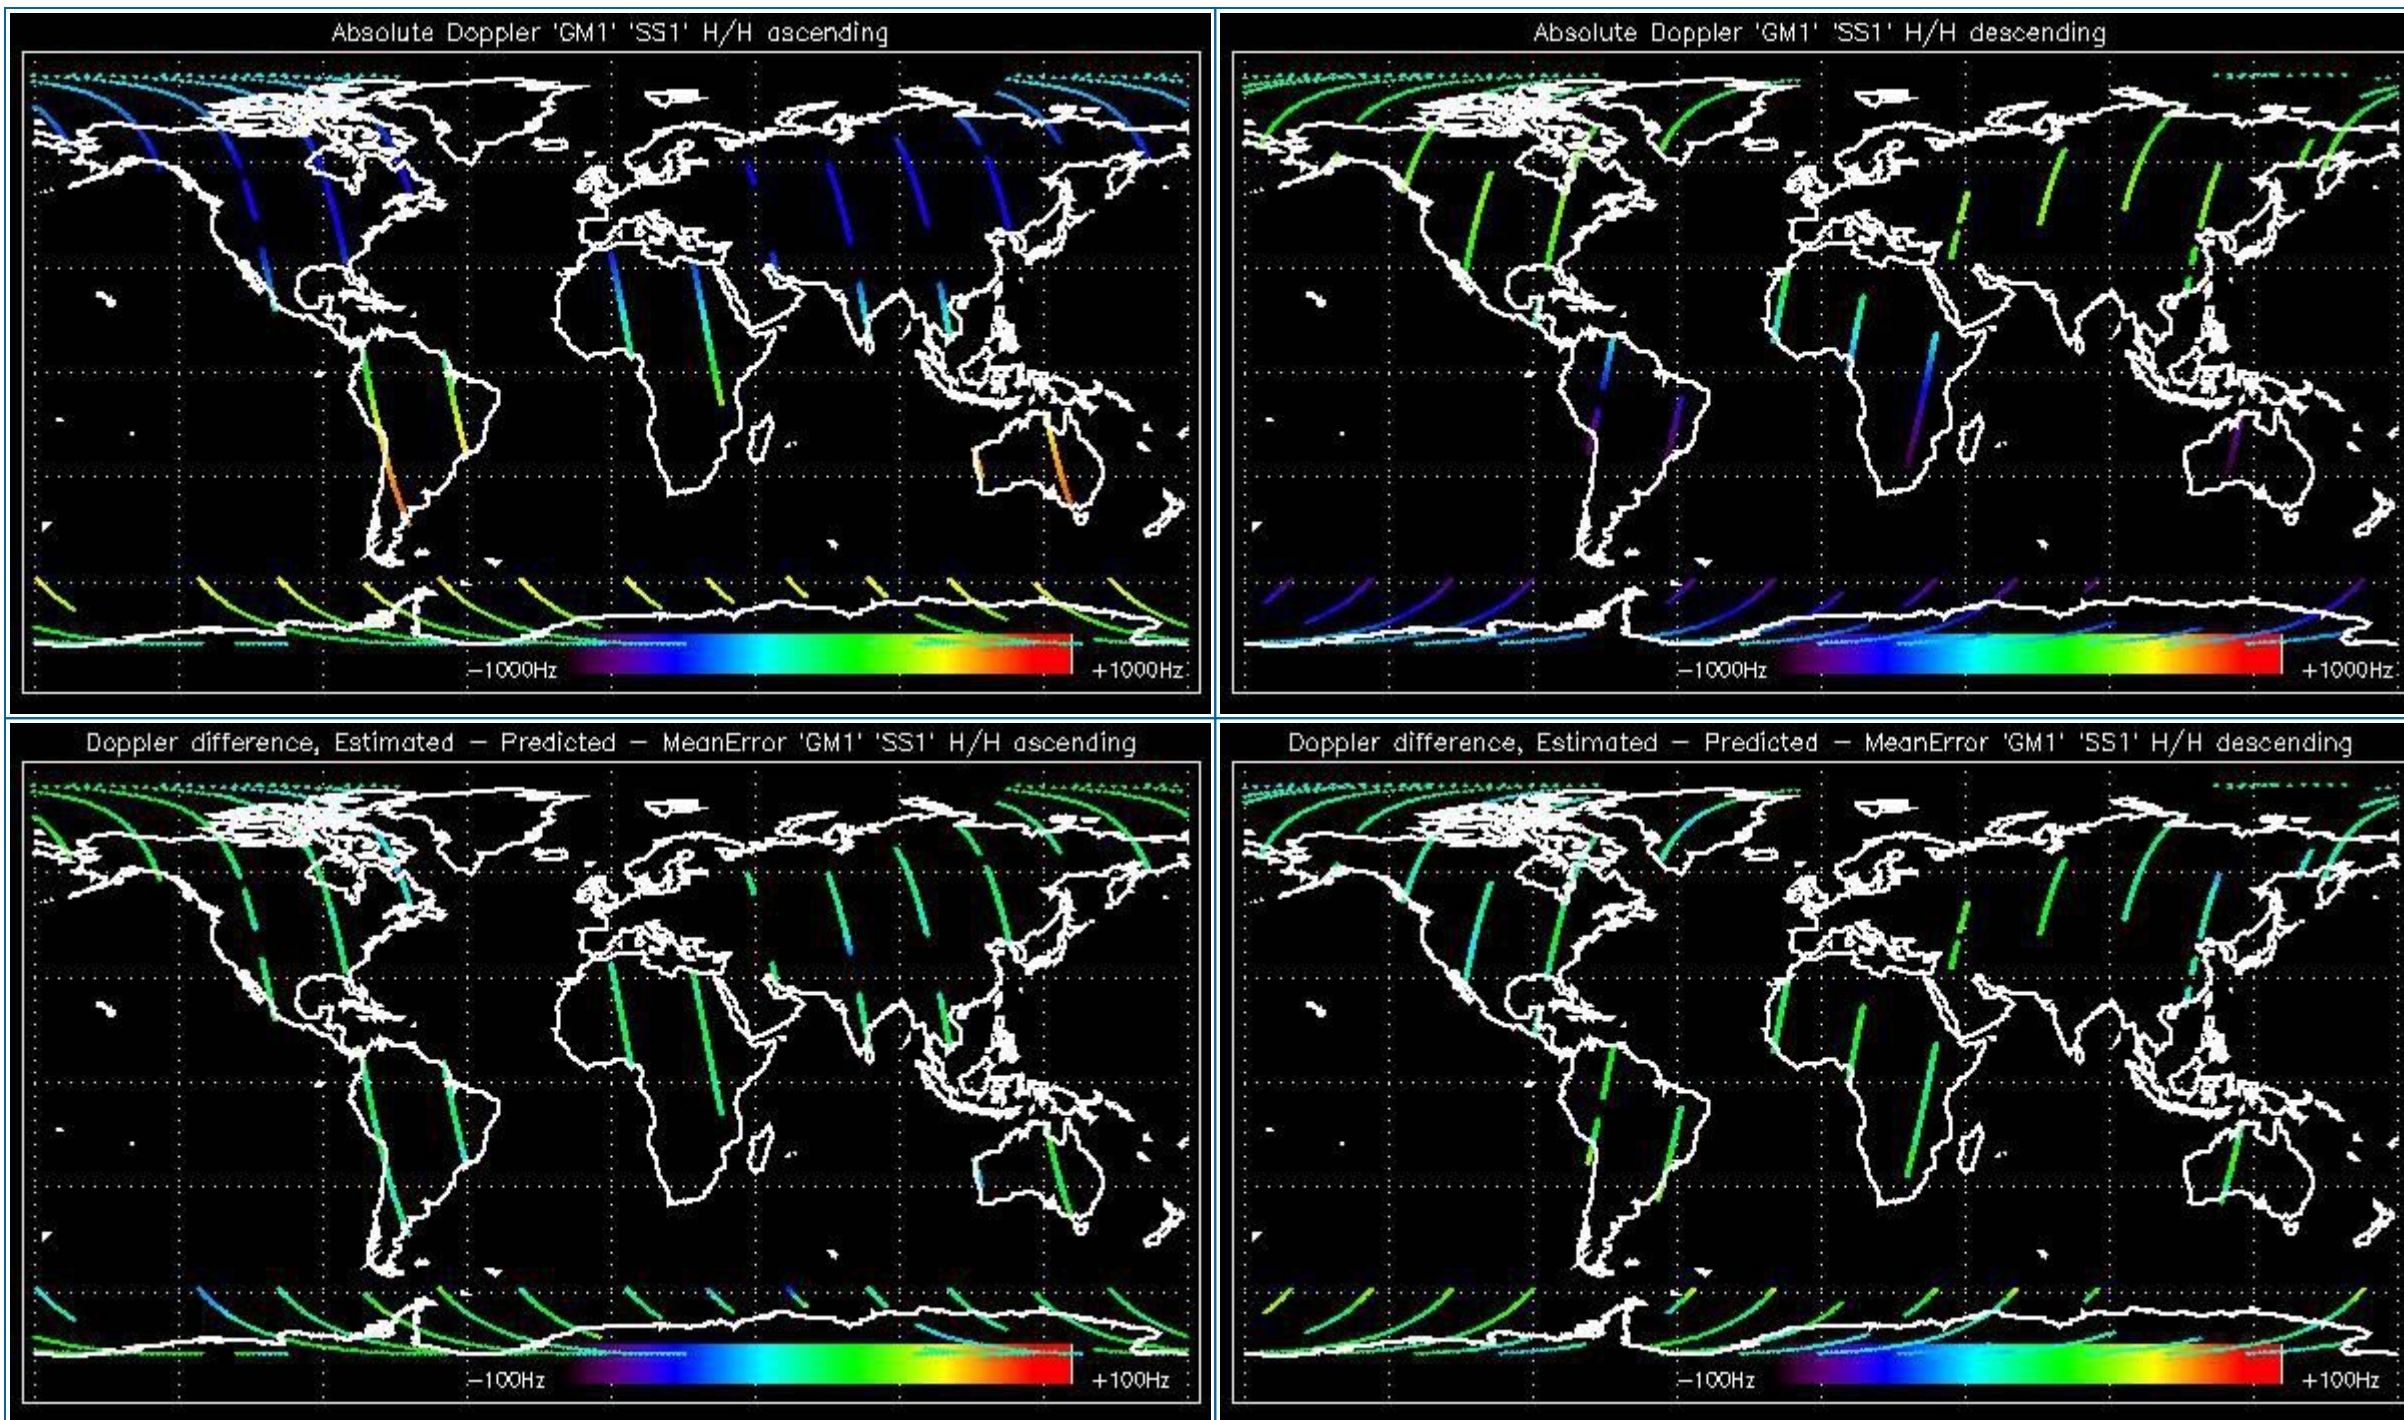

5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




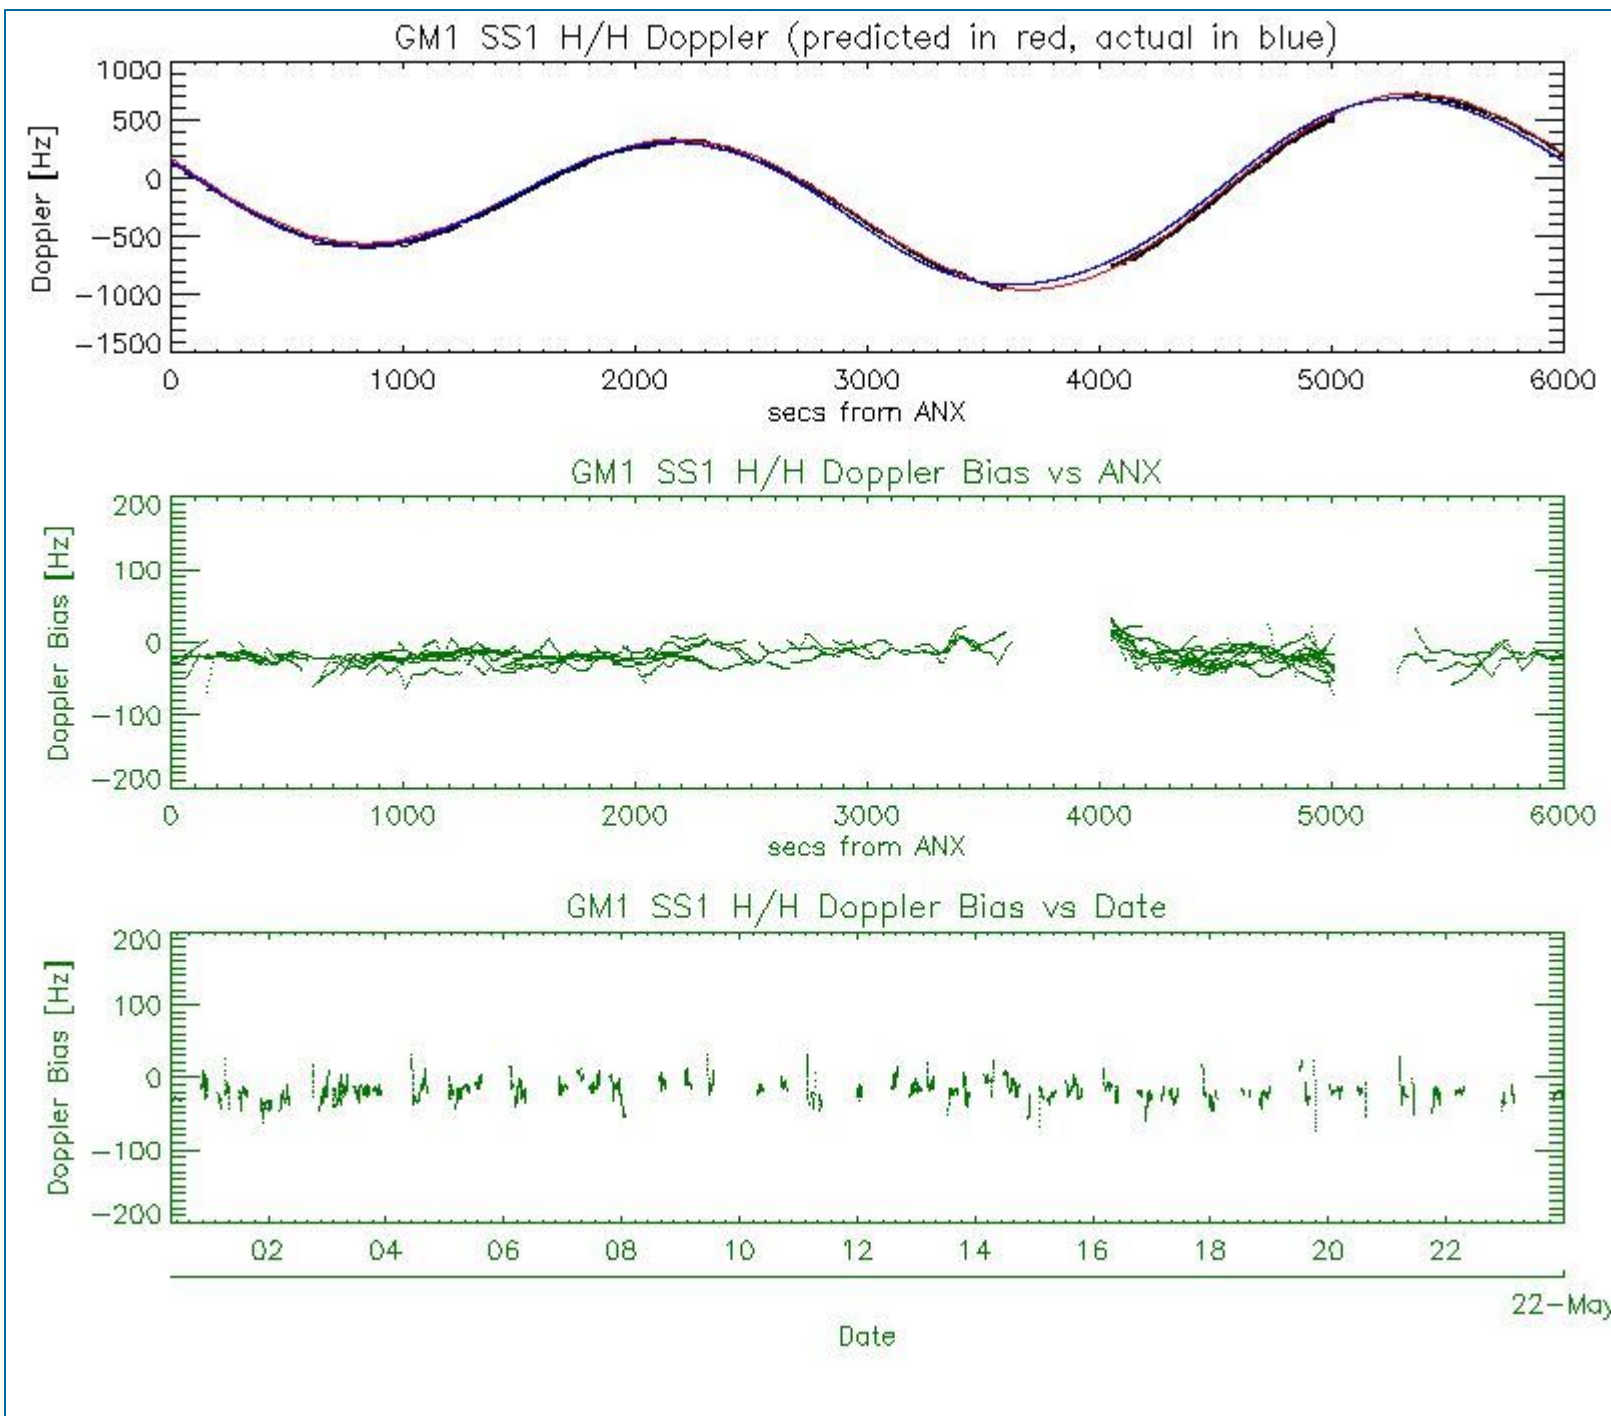

5.3 - Doppler JUMPS Analysis for WSM

[BACK TO MENU]



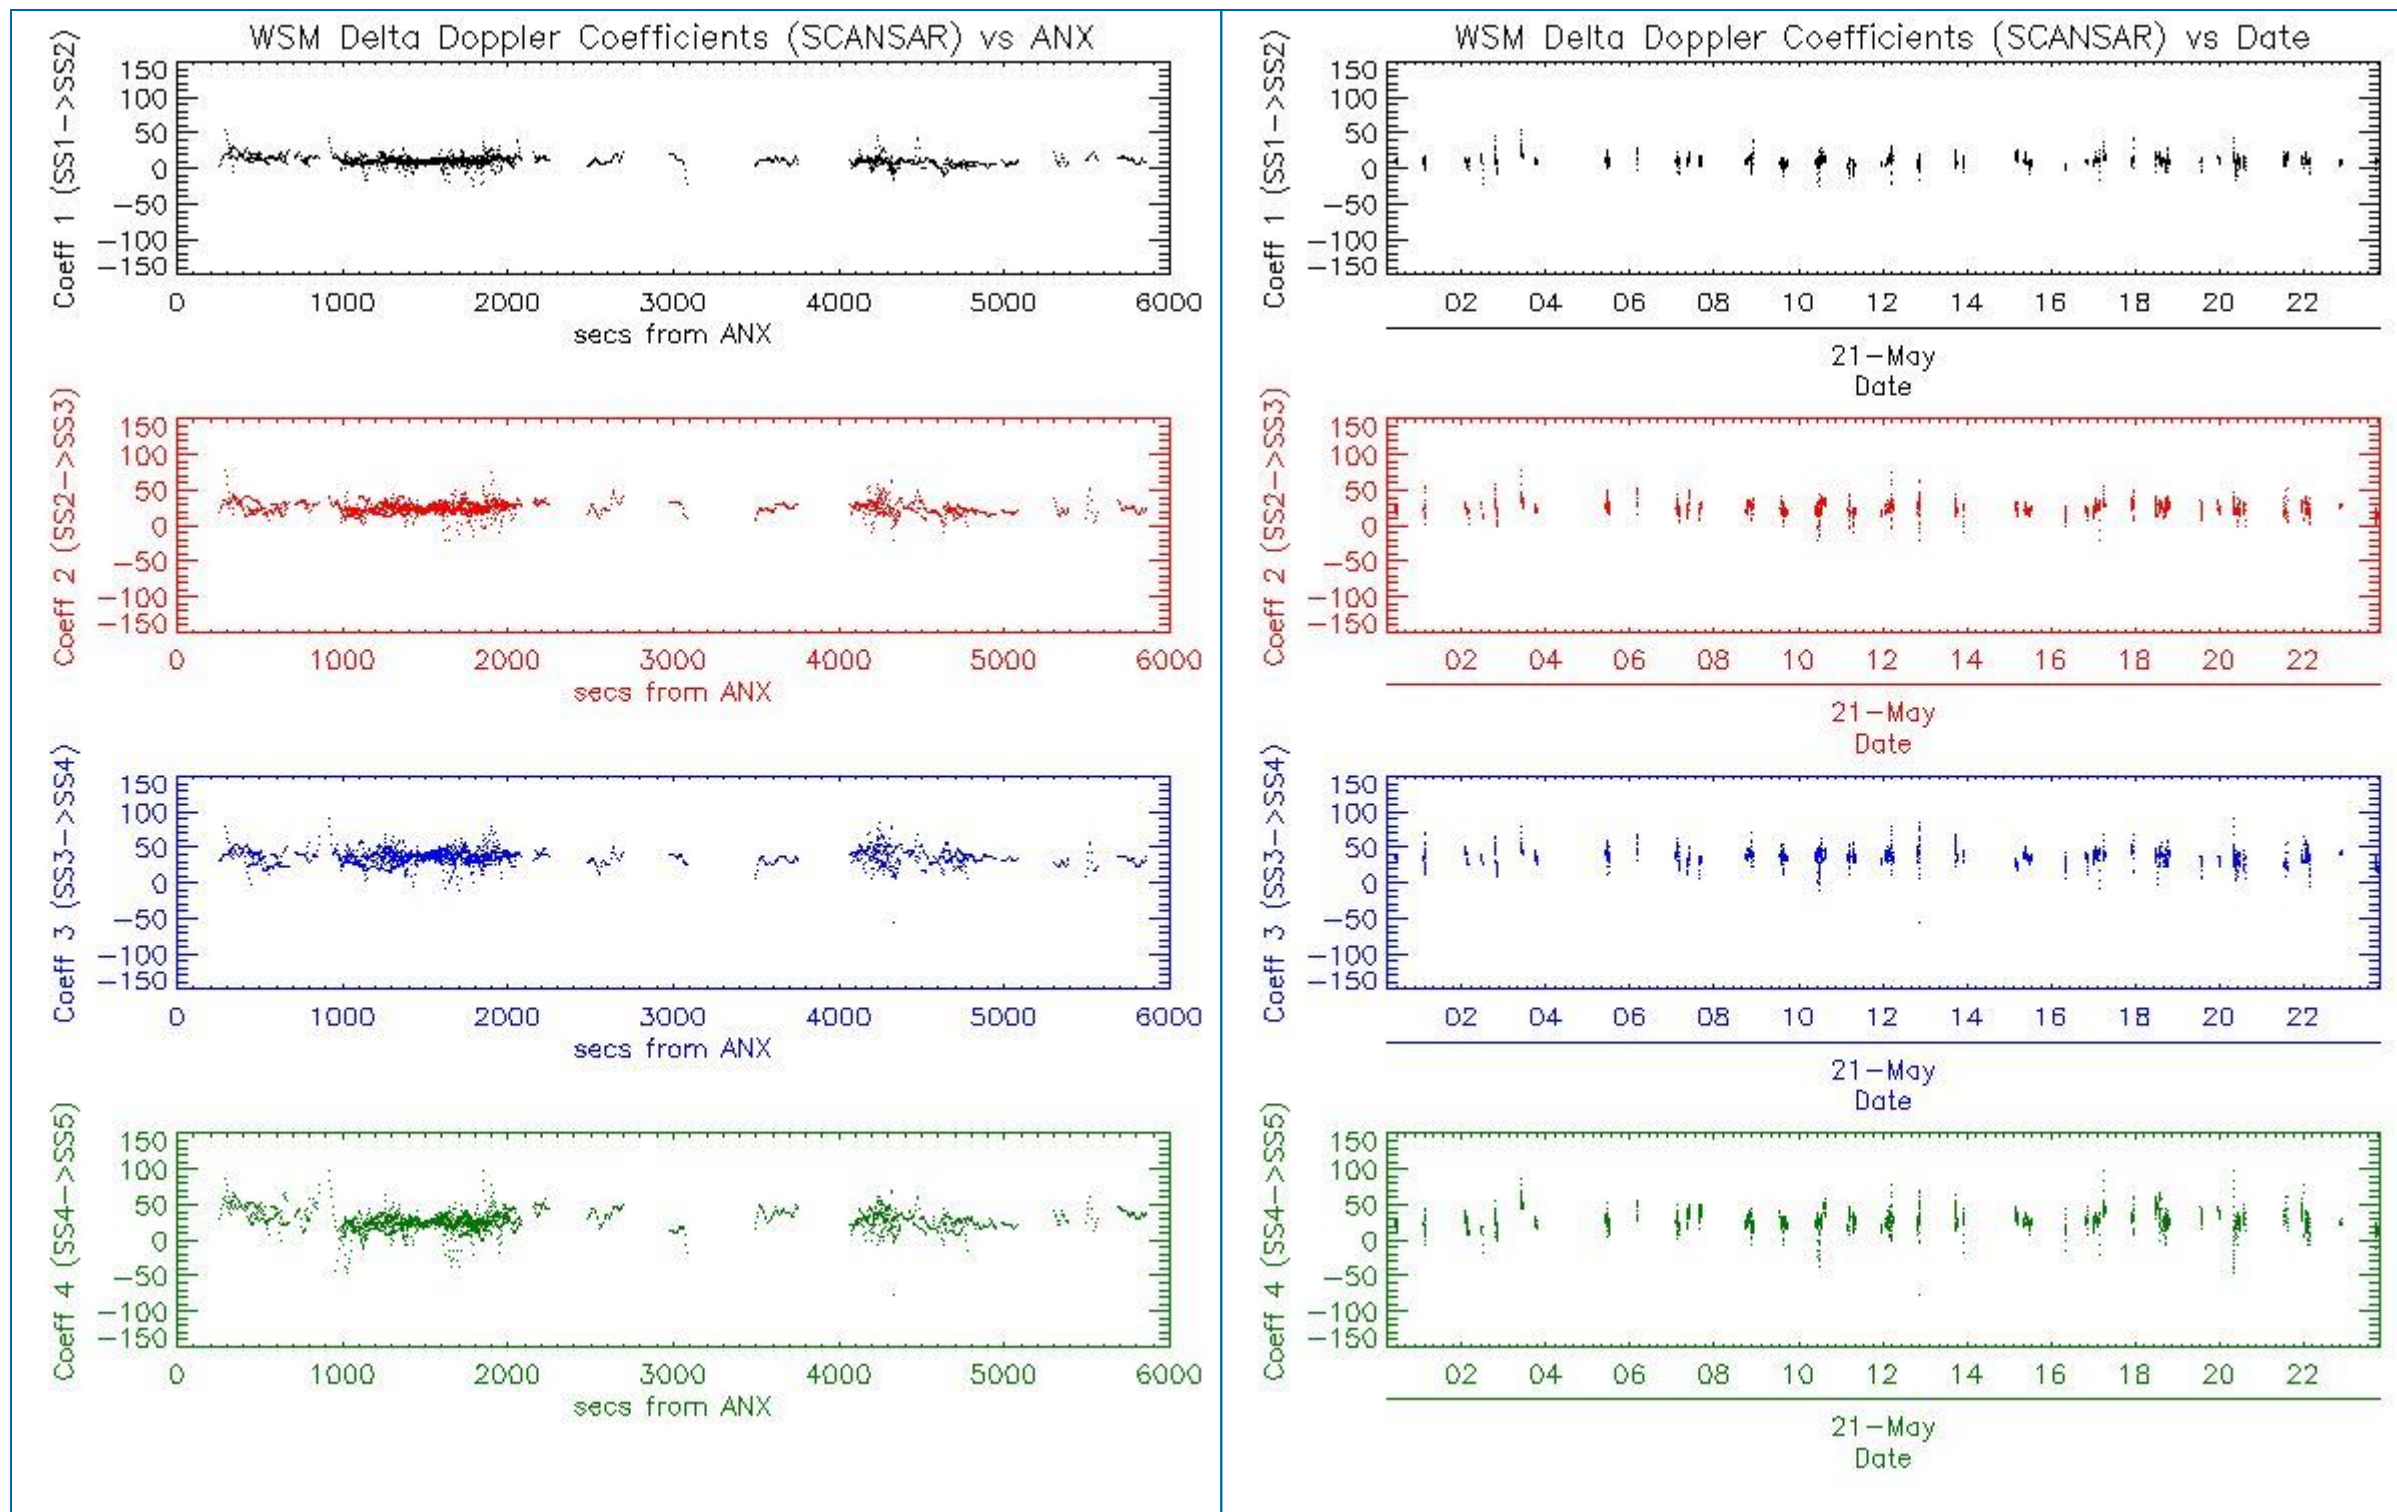



6 - CHIRP ANALYSIS

6.1 - Analysis for WSM SS1 H/H

6.1.1 - ScaleFactor

[[BACK TO MENU](#)]





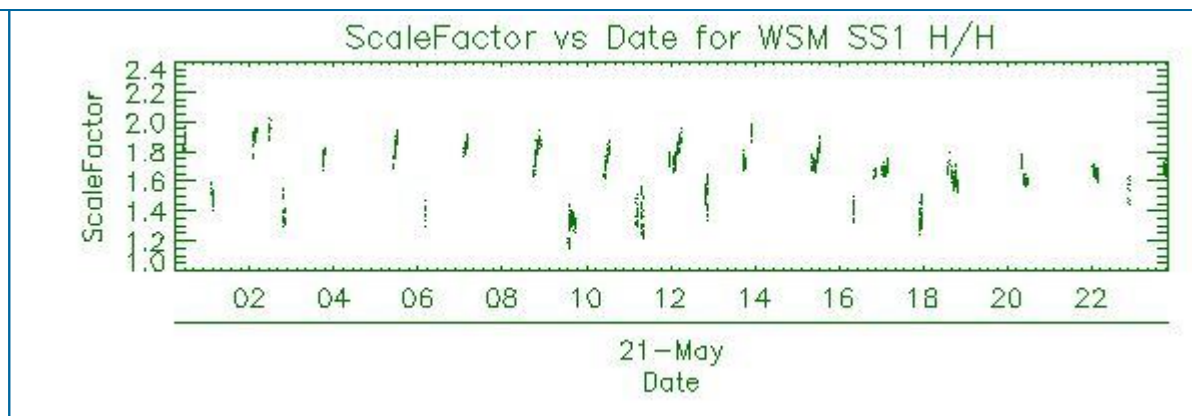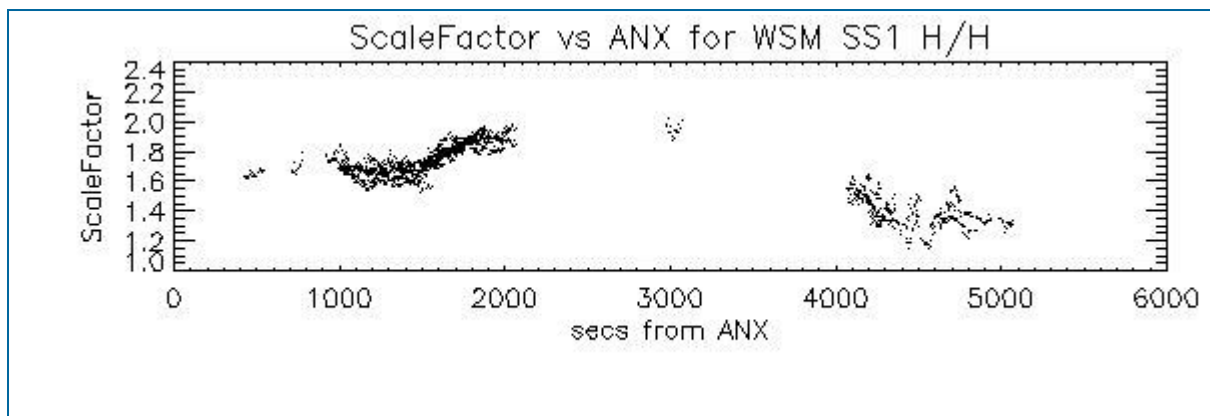

6.2 - Analysis for WSM SS1 V/V

6.2.1 - ScaleFactor

[[BACK TO MENU](#)]


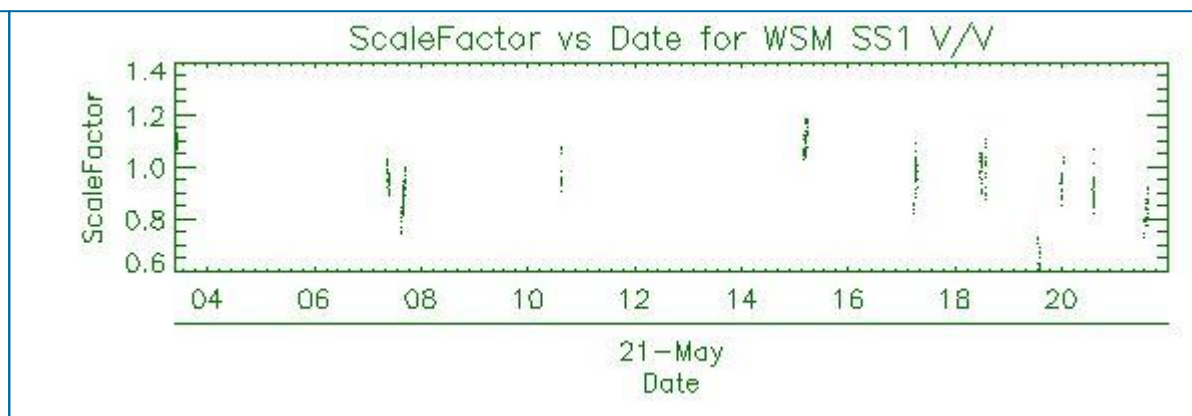
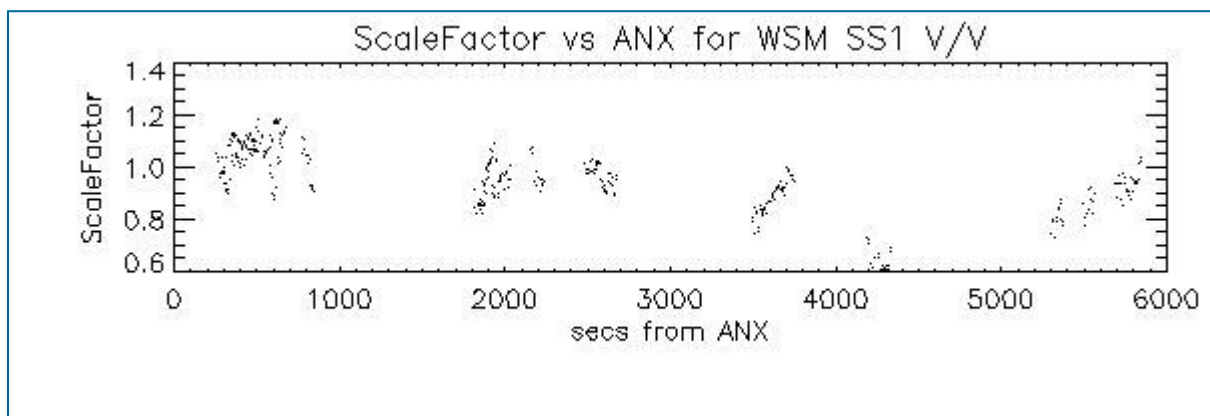


7 - RAW DATA ANALYSIS

7.1 - Analysis for WVS

[[BACK TO MENU](#)]

--	--	--

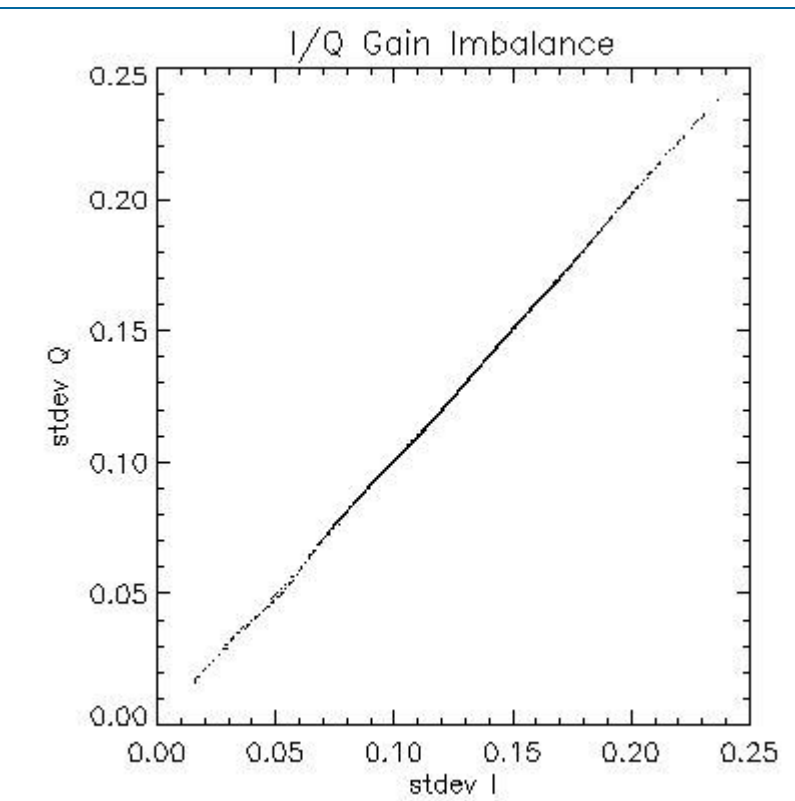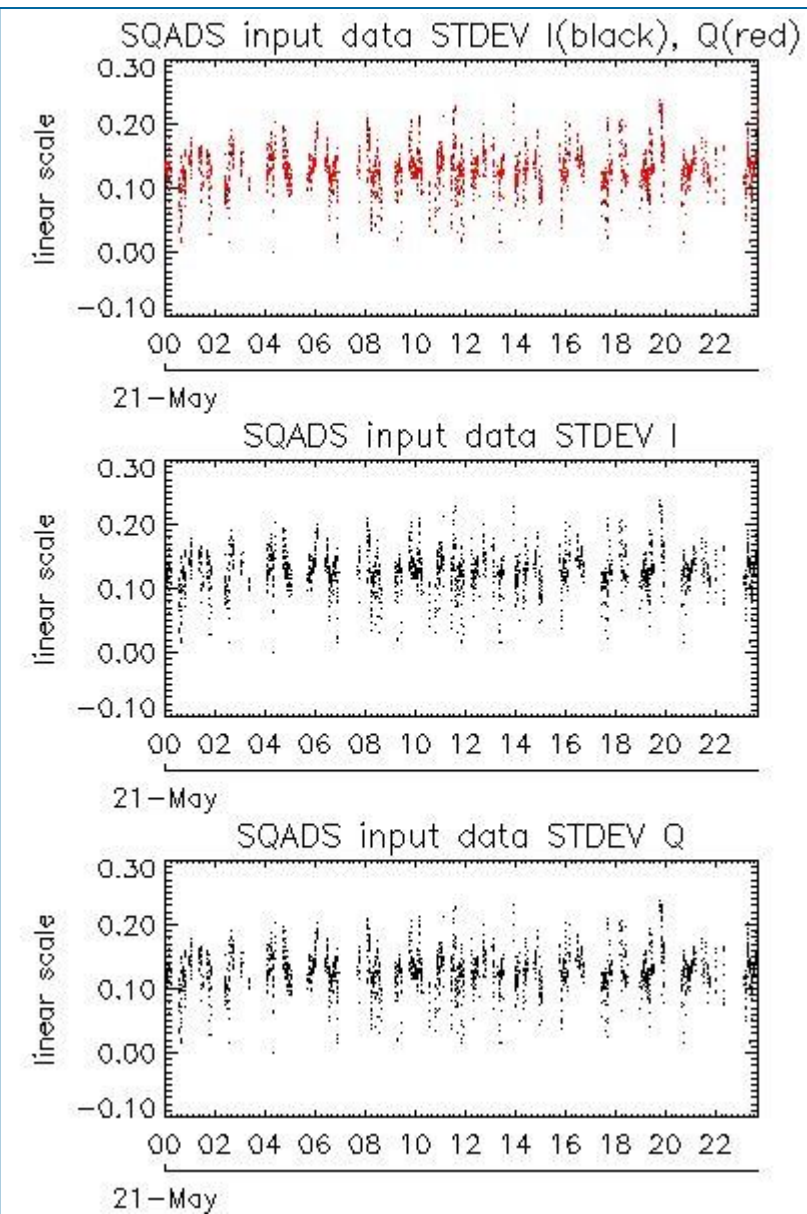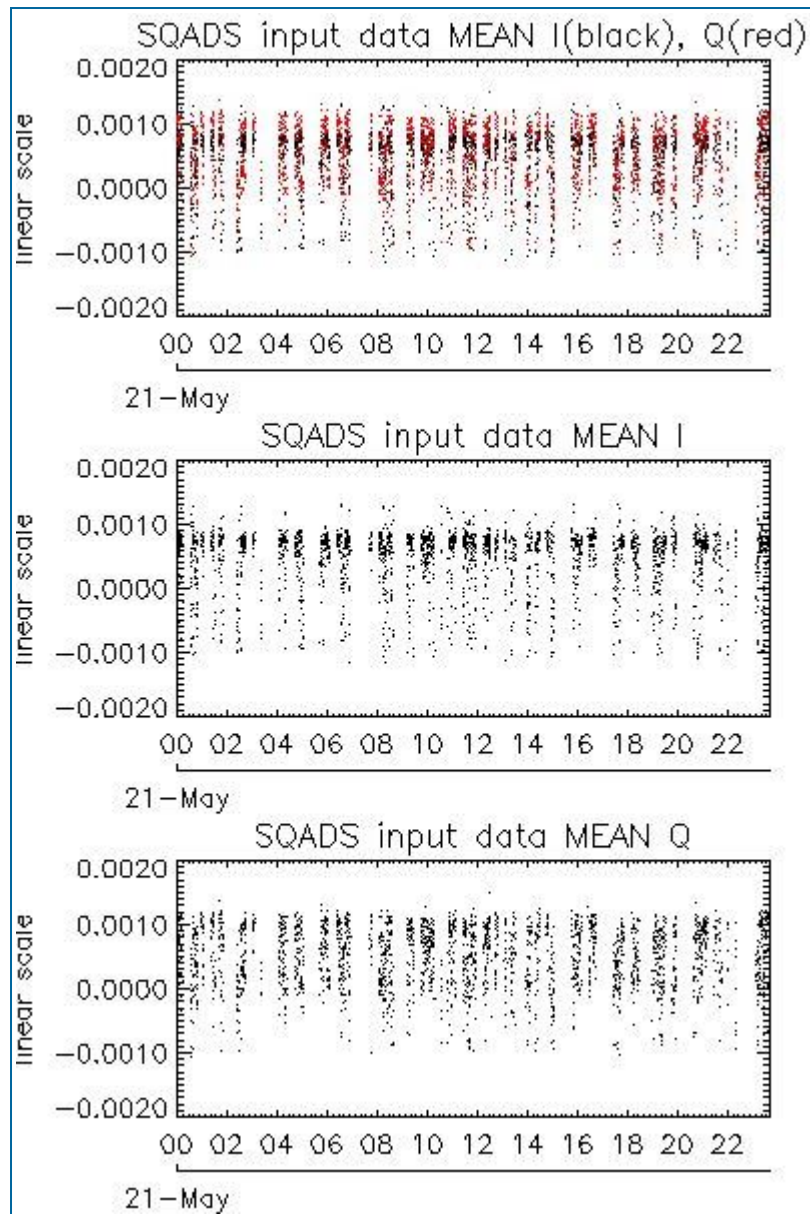


Channel	Statistics	DSS-B
MEAN I	mean	0.000462321
	stdev	2.29608e-07
MEAN Q	mean	0.000503066
	stdev	2.38643e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.127975
	stdev	0.00104334
STDEV Q	mean	0.128283
	stdev	0.00105505

7.2 - Analysis for IMM

[[BACK TO MENU](#)]



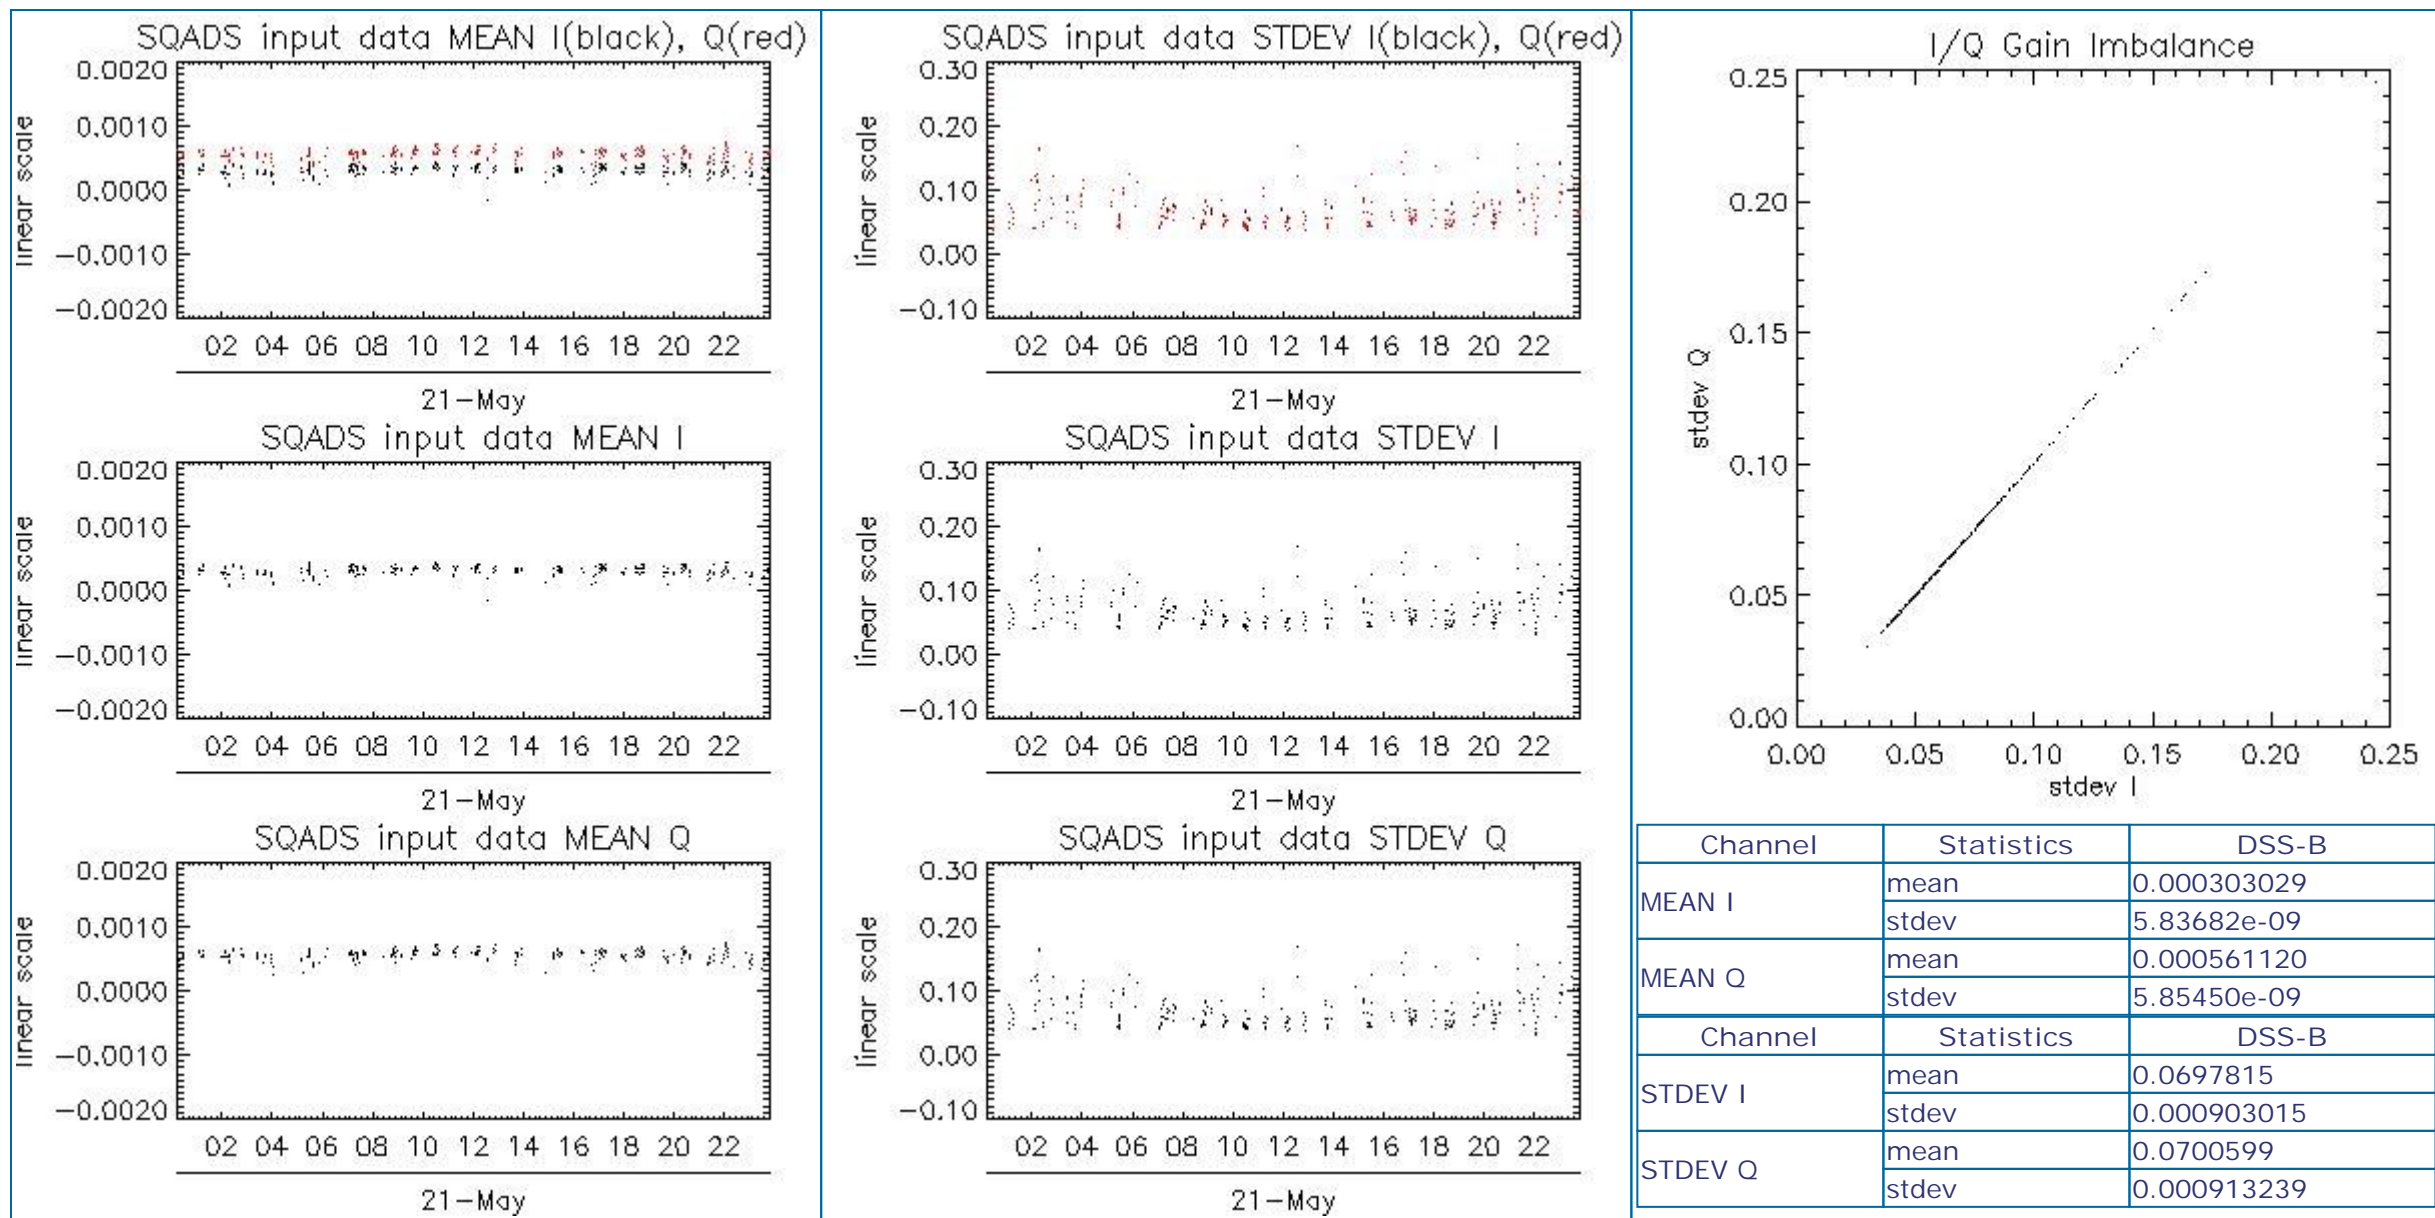


8 - TELEMETRY ANALYSIS

Processing Center	Product	Gaps	Missing lines
PDE	ASA_WSM_1PNPDE20090521_032321_000000732079_00133_37762_4941.N1	0	34
PDE	ASA_WSM_1PNPDE20090521_032321_000002252079_00133_37762_5133.N1	0	34
PDE	ASA_WSM_1PNPDE20090521_182807_000000922079_00142_37771_5609.N1	0	70

8.1 - Number of Missing lines


[[BACK TO MENU](#)]



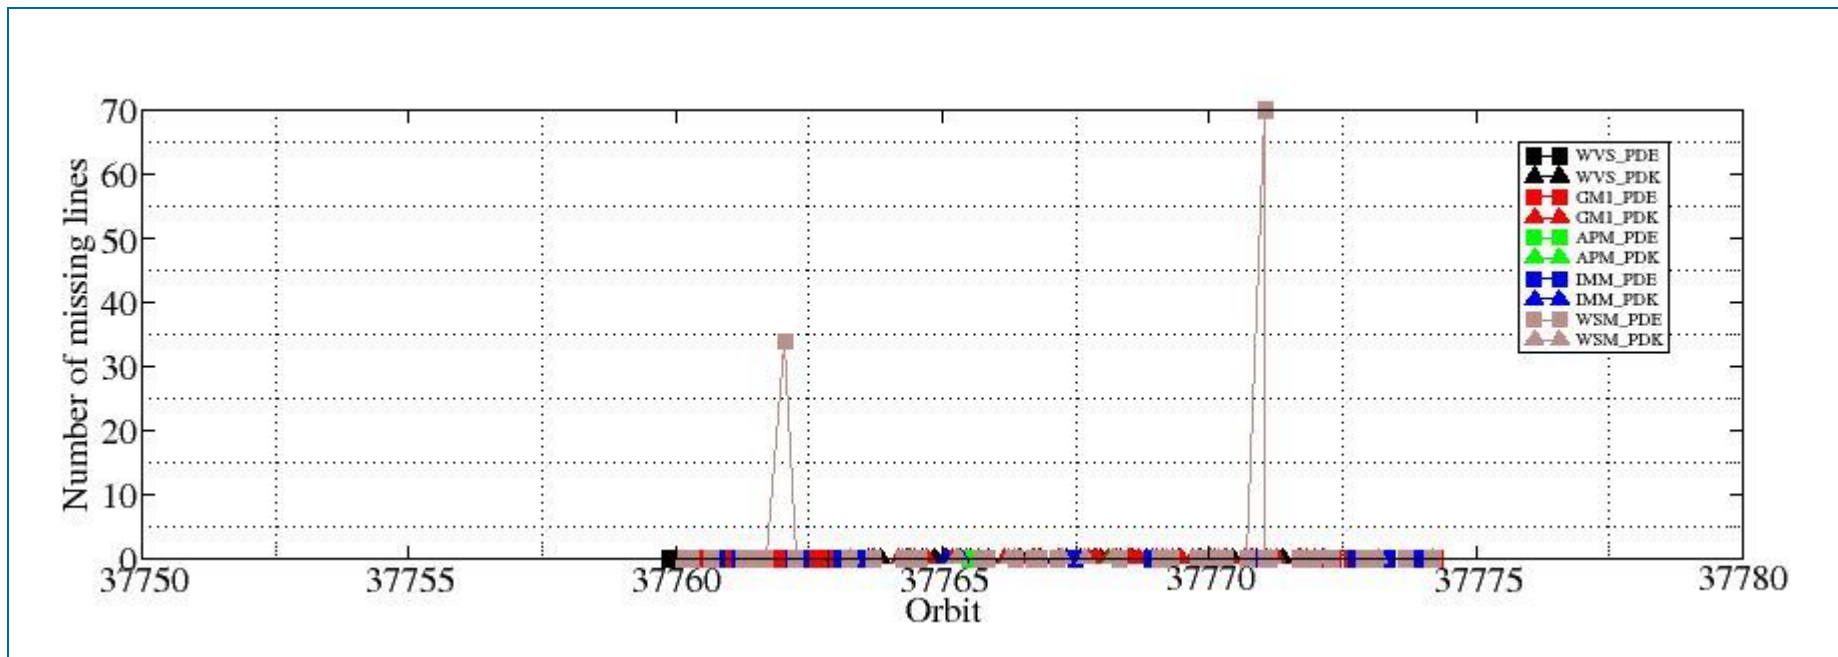

8.2 - Number of Gaps

[\[BACK TO MENU \]](#)

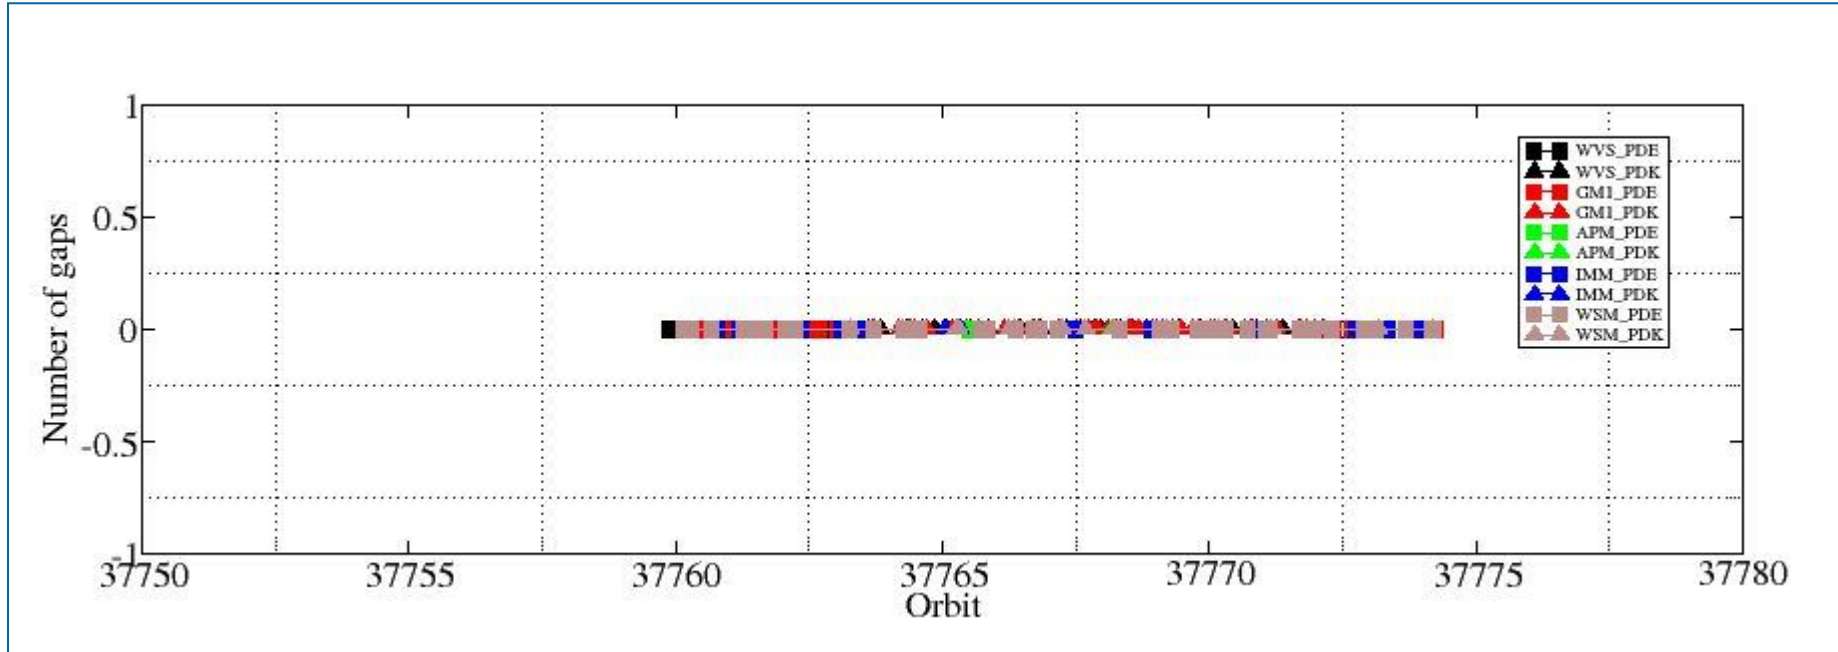

ASAR DAILY REPORT for 090521
#####

MODE: DAILY
ANALYSIS: ALL
DATE: YESTERDAY

Analysis will be performed from 2009-05-21 00:00:00 to 2009-05-21 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/090521/

DATA SUMMARY

Summary will be performed from 2009-05-21 00:00:00 to 2009-05-21 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/090521/DATA_SUMMARY

Creating directory ./RESULTS/DAILY/090521/DATA_SUMMARY...
Writing file ./RESULTS/DAILY/090521/DATA_SUMMARY/Data_summary.html...

Getting WVS products list from 2009-05-21 00:00:00 to 2009-05-21 23:59:59...
Writing file ./RESULTS/DAILY/090521/DATA_SUMMARY/List_WVS_products_used.xls...
Writing file ./RESULTS/DAILY/090521/DATA_SUMMARY/List_WVS_products_used.txt...

Getting GM1 products list from 2009-05-21 00:00:00 to 2009-05-21 23:59:59...
Writing file ./RESULTS/DAILY/090521/DATA_SUMMARY/List_GM1_products_used.xls...
Writing file ./RESULTS/DAILY/090521/DATA_SUMMARY/List_GM1_products_used.txt...

Getting APM products list from 2009-05-21 00:00:00 to 2009-05-21 23:59:59...
Writing file ./RESULTS/DAILY/090521/DATA_SUMMARY/List_APM_products_used.xls...
Writing file ./RESULTS/DAILY/090521/DATA_SUMMARY/List_APM_products_used.txt...

Getting IMM products list from 2009-05-21 00:00:00 to 2009-05-21 23:59:59...
Writing file ./RESULTS/DAILY/090521/DATA_SUMMARY/List_IMM_products_used.xls...
Writing file ./RESULTS/DAILY/090521/DATA_SUMMARY/List_IMM_products_used.txt...

Getting WSM products list from 2009-05-21 00:00:00 to 2009-05-21 23:59:59...
Writing file ./RESULTS/DAILY/090521/DATA_SUMMARY/List_WSM_products_used.xls...
Writing file ./RESULTS/DAILY/090521/DATA_SUMMARY/List_WSM_products_used.txt...

Getting MS products list from 2009-05-21 00:00:00 to 2009-05-21 23:59:59...
Writing file ./RESULTS/DAILY/090521/DATA_SUMMARY/List_MS_products_used.xls...
Writing file ./RESULTS/DAILY/090521/DATA_SUMMARY/List_MS_products_used.txt...

DATA SUMMARY completed
#####

AUXILIARY FILES ANALYSIS

Analysis will be performed from 2009-05-21 00:00:00 to 2009-05-21 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/090521/AUXILIARY

Creating directory ./RESULTS/DAILY/090521/AUXILIARY...

Looking for the IECF operational ADFs list...



Found list 20090521_030003_current_3_IECF_ADFs.txt...
Extracting ADFs...

ASA_CON_AXVIEC20081215_141339_20070204_165113_20091231_000000
ASA_INS_AXVIEC20081215_140905_20070307_060000_20091231_000000
ASA_XCH_AXVIEC20081215_143642_20020301_000000_20091231_000000
ASA_XCA_AXVIEC20090311_104501_20080801_000000_20091231_235959

Writing file ./RESULTS/DAILY/090521/AUXILIARY/ASAR_ADFs_IECF_List3.html...
Writing file ./RESULTS/DAILY/090521/AUXILIARY/Auxiliary_files_summary.html...

Analysing WVS products...

Writing file ./RESULTS/DAILY/090521/AUXILIARY/Check_ADFs_WVS.xls...
Writing file ./RESULTS/DAILY/090521/AUXILIARY/Check_ADFs_WVS.txt...

ASA_WVS_1PNPDE20090521_003117_000011442079_00131_37760_4546.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_005738_000003902079_00131_37760_4549.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_012051_000002702079_00131_37760_4561.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_012436_000003452079_00131_37760_4688.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_013931_000007042079_00132_37761_4704.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_022228_000002542079_00132_37761_4701.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_022920_000008242079_00132_37761_4714.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_024235_000001202079_00132_37761_4872.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_030127_000002252079_00132_37761_4869.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_032115_000000892079_00133_37762_4853.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_040310_000009892079_00133_37762_4858.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_041909_000001202079_00133_37762_5115.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_042412_000000602079_00133_37762_5102.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_044203_000012742079_00133_37762_5099.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_054228_000004942079_00134_37763_5123.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_055213_000004792079_00134_37763_5084.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_203838_000019492079_00143_37772_5657.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_212802_000002402079_00143_37772_5660.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_213421_000000442079_00143_37772_6246.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_214033_000002842079_00143_37772_5808.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_215929_000001052079_00144_37773_5811.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_221728_000001352079_00144_37773_5814.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_230838_000003152079_00144_37773_5828.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_231308_000009592079_00144_37773_5957.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_233046_000002842079_00145_37774_5954.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090521_233702_000002552079_00145_37774_5960.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_055958_000003452079_00134_37763_5249.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_062239_000019642079_00134_37763_5268.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_074223_000002402079_00135_37764_5331.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_080315_000012892079_00135_37764_5334.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_082606_000006892079_00136_37765_5339.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_091131_000009292079_00136_37765_5472.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_094508_000019192079_00136_37765_5482.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_103425_000001052079_00137_37766_5608.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_104902_000011092079_00137_37766_5617.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_112427_000019492079_00137_37766_5700.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_121501_000010042079_00138_37767_5748.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_124133_000004052079_00138_37767_5753.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_130503_000003002079_00138_37767_5756.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_131843_000007272079_00138_37767_5784.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_135655_000007192079_00139_37768_5893.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_141915_000005702079_00139_37768_5898.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_144538_000003752079_00139_37768_5903.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_145628_000004792079_00139_37768_5969.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_154458_000000892079_00140_37769_6019.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_154934_000011842079_00140_37769_6028.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_162614_000010342079_00140_37769_6035.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_172624_000014242079_00141_37770_6154.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090521_181023_000010192079_00141_37770_6159.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK



ASA_WVS_1PNPDK20090521_185952_000018442079_00142_37771_6273.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_WVS_1PNPDK20090521_194726_000006302079_00142_37771_6278.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing GM1 products...

Writing file ./RESULTS/DAILY/090521/AUXILIARY/Check_ADFs_GM1.xls...

Writing file ./RESULTS/DAILY/090521/AUXILIARY/Check_ADFs_GM1.txt...

ASA_GM1_1PNPDE20090521_002102_000002592079_00131_37760_4538.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_002900_000001322079_00131_37760_4540.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_005106_000003922079_00131_37760_4553.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_010851_000002112079_00131_37760_4551.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_011604_000002832079_00131_37760_4563.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_013100_000005072079_00131_37760_4690.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_015157_000004102079_00132_37761_4692.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_015945_000002592079_00132_37761_4698.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_021136_000003082079_00132_37761_4696.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_021817_000000842079_00132_37761_4694.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_022044_000000962079_00132_37761_4711.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_024522_000000722079_00132_37761_4874.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_025057_000006282079_00132_37761_4930.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_030554_000001692079_00132_37761_4866.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_030846_000007432079_00132_37761_4862.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_032712_000007122079_00133_37762_4860.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_033955_000002172079_00133_37762_4855.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_034706_000005252079_00133_37762_4850.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_042558_000009302079_00133_37762_5106.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_050358_000003022079_00134_37763_5104.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_051119_000001932079_00134_37763_5088.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_051534_000005732079_00134_37763_5086.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_053130_000003682079_00134_37763_5090.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_202941_000002952079_00143_37772_5637.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_203715_000000782079_00143_37772_5639.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_211158_000005012079_00143_37772_5647.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_212551_000001262079_00143_37772_5654.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_214605_000005072079_00144_37773_6248.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_220934_000004712079_00144_37773_5820.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_225722_000001692079_00144_37773_5818.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_230553_000001632079_00144_37773_6250.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20090521_234932_000007312079_00145_37774_5962.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_060634_000001502079_00134_37763_5246.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_061052_000007062079_00134_37763_5251.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_065601_000005492079_00135_37764_5259.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_071539_000001442079_00135_37764_5324.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_071849_000001322079_00135_37764_5326.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_072703_000006462079_00135_37764_5328.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_074827_000008882079_00135_37764_5336.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_083820_000004042079_00136_37765_5341.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_090434_000003682079_00136_37765_5469.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_092746_000003682079_00136_37765_5474.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_101751_000004282079_00137_37766_5532.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_104303_000003562079_00137_37766_5612.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_110822_000001322079_00137_37766_5610.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_111358_000001752079_00137_37766_5614.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_112132_000001752079_00137_37766_5619.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_115954_000002592079_00138_37767_5685.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_123357_000004532079_00138_37767_5750.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_125355_000006642079_00138_37767_5758.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_131047_000004772079_00138_37767_5760.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_133248_000003982079_00139_37768_5762.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_134028_000001442079_00139_37768_5769.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_134822_000003682079_00139_37768_5888.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_140934_000002592079_00139_37768_5890.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_141534_000002172079_00139_37768_5895.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20090521_142934_000009302079_00139_37768_5900.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

ASA_GM1_1PNPDK20090521_145359_000001442079_00139_37768_5905.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_150512_000002712079_00140_37769_5907.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_151422_000004282079_00140_37769_5971.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_153310_000007062079_00140_37769_6021.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_154710_000001442079_00140_37769_6023.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_161010_000005732079_00140_37769_6025.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_162220_000002292079_00140_37769_6030.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_164553_000002652079_00141_37770_6032.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_165331_000003922079_00141_37770_6042.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_171021_000001202079_00141_37770_6142.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_171734_000005252079_00141_37770_6144.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_175046_000002532079_00141_37770_6147.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_175856_000002652079_00141_37770_6149.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_180508_000001022079_00141_37770_6151.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_183122_000001202079_00142_37771_6156.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_183858_000001022079_00142_37771_6166.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_185009_000005792079_00142_37771_6264.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_193122_000001322079_00142_37771_6266.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_193631_000002772079_00142_37771_6268.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_194542_000001022079_00142_37771_6270.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090521_200142_000006942079_00142_37771_6275.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing APM products...

Writing file ./RESULTS/DAILY/090521/AUXILIARY/Check_ADFs_APM.xls...

Writing file ./RESULTS/DAILY/090521/AUXILIARY/Check_ADFs_APM.txt...

ASA_APM_1PNPDE20090521_021002_000000742079_00132_37761_4798.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20090521_021941_000000402079_00132_37761_4789.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20090521_091042_000000432079_00136_37765_5191.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDK20090521_133925_000000412079_00139_37768_5853.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing IMM products...

Writing file ./RESULTS/DAILY/090521/AUXILIARY/Check_ADFs_IMM.xls...

Writing file ./RESULTS/DAILY/090521/AUXILIARY/Check_ADFs_IMM.txt...

ASA_IMM_1PNPDE20090521_001453_000000632079_00131_37760_4644.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_001453_000002022079_00131_37760_4673.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_001756_000000192079_00131_37760_4650.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_011221_000000632079_00131_37760_4636.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_011221_000002112079_00131_37760_4665.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_011524_000000282079_00131_37760_4642.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_015848_000000462079_00132_37761_4681.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_021644_000000822079_00132_37761_4820.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_033905_000000382079_00133_37762_4864.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_035552_000003912079_00133_37762_4973.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_050859_000001282079_00134_37763_4991.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_051431_000000502079_00134_37763_4971.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_053735_000002352079_00134_37763_5070.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_055115_000000532079_00134_37763_4975.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_071801_000000372079_00135_37764_5108.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_072531_000000622079_00135_37764_5135.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_072531_000000812079_00135_37764_5195.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_123224_000000812079_00138_37767_5314.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_123224_000000812079_00138_37767_5316.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_145311_000000372079_00139_37768_5390.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_164412_000000772079_00141_37770_5440.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_165232_000000472079_00141_37770_5404.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_171219_000000402079_00141_37770_5430.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_180320_000000982079_00141_37770_5436.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_194107_000000632079_00142_37771_5507.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

```
ASA_IMM_1PNPDE20090521_194107_000000632079_00142_37771_5611.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_194107_000000632079_00142_37771_5667.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_194107_000002652079_00142_37771_6198.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_194310_000000602079_00142_37771_5671.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_194411_000000592079_00142_37771_5513.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_212016_000003242079_00143_37772_6252.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_212219_000001192079_00143_37772_5830.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_215429_000000632079_00144_37773_5752.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_215429_000000682079_00144_37773_6200.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_222019_000000592079_00144_37773_5910.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_230008_000003342079_00144_37773_5951.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_232948_000000532079_00145_37774_5990.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090521_233604_000000532079_00145_37774_5912.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20090521_071107_000002622079_00135_37764_5317.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20090521_082515_000000442079_00136_37765_5415.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20090521_085514_000001712079_00136_37765_5450.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20090521_201708_000001152079_00143_37772_6356.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

Analysing WSM products...

Writing file ./RESULTS/DAILY/090521/AUXILIARY/Check_ADFs_WSM.xls...

Writing file ./RESULTS/DAILY/090521/AUXILIARY/Check_ADFs_WSM.txt...

```
ASA_WSM_1PNPDE20090521_001318_000000672079_00131_37760_4632.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_002526_000000732079_00131_37760_4654.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_002526_000001892079_00131_37760_4822.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_010529_000001892079_00131_37760_4660.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_020409_000003302079_00132_37761_4949.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_020623_000000552079_00132_37761_4812.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_020921_000000182079_00132_37761_4818.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_022723_000001162079_00132_37761_4787.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_024637_000002502079_00132_37761_4824.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_032321_000000732079_00133_37762_4941.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_032321_000002252079_00133_37762_5133.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_034337_000000732079_00133_37762_4932.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_034337_000001892079_00133_37762_5156.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_052511_000002502079_00134_37763_5158.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_052511_000003732079_00134_37763_5228.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_060911_000000982079_00134_37763_5075.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_070513_000000912079_00135_37764_5178.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_070626_000000182079_00135_37764_5112.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_072105_000002132079_00135_37764_5170.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_073752_000002692079_00135_37764_5193.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_093401_000000732079_00136_37765_5349.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_093401_000000732079_00136_37765_5764.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_093401_000001342079_00136_37765_5374.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_093401_0000005312079_00136_37765_5438.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_093514_000000612079_00136_37765_6285.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_093615_000003552079_00136_37765_5914.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_093710_000000612079_00136_37765_5355.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_093811_000001232079_00136_37765_6420.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_093913_000000612079_00136_37765_5328.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_093913_000001212079_00136_37765_5372.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_094014_000001572079_00136_37765_5631.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_094210_000000422079_00136_37765_5365.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_094322_000001032079_00136_37765_5312.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_094322_000001032079_00136_37765_5347.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_103654_000000732079_00137_37766_5292.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_103654_000000912079_00137_37766_5310.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_103654_000000912079_00137_37766_5367.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_111040_000001892079_00137_37766_5422.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_111040_000001892079_00137_37766_5597.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_111153_000000612079_00137_37766_5342.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_111254_000000552079_00137_37766_5276.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_111658_000000732079_00137_37766_5282.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```


ASA_WSM_1PNPDE20090521_111658_000000732079_00137_37766_5621.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_111658_000002692079_00137_37766_5378.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_112008_000000612079_00137_37766_5627.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_112109_000000182079_00137_37766_5304.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5252.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5256.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5537.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5593.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5599.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5633.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_6211.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_135436_000001352079_00139_37768_5519.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_150950_000001892079_00140_37769_5424.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_150950_000002502079_00140_37769_5489.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_153116_000001102079_00140_37769_5491.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_161946_000001532079_00140_37769_5418.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_165022_000001352079_00141_37770_5517.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_165136_000000612079_00141_37770_5408.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_171400_000002082079_00141_37770_5470.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_175501_000001902079_00141_37770_5485.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_175501_000002262079_00141_37770_5591.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_182807_000000922079_00142_37771_5609.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_182905_000001342079_00142_37771_5493.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_183326_000000972079_00142_37771_5487.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_183541_000000732079_00142_37771_5462.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_183541_000000912079_00142_37771_5475.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_193341_000001342079_00142_37771_5579.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_193341_000001652079_00142_37771_5760.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_195839_000000732079_00142_37771_5541.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_195839_000000732079_00142_37771_5641.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_195839_000001762079_00142_37771_6205.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_203441_000000732079_00143_37772_5743.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_203441_000001532079_00143_37772_6235.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_213251_000000912079_00143_37772_5762.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_213559_000000732079_00143_37772_5782.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_215757_000000922079_00144_37773_5802.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_225248_000000732079_00144_37773_5931.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_234206_000000732079_00145_37774_6067.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090521_234702_000001352079_00145_37774_6080.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_052654_000002132079_00134_37763_5601.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_070611_000002872079_00135_37764_5321.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_084510_000002862079_00136_37765_5461.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_085051_000002512079_00136_37765_5463.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_102506_000005512079_00137_37766_5605.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_103647_000000732079_00137_37766_5561.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_120419_000000922079_00138_37767_5710.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_120622_000005202079_00138_37767_5745.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_124920_000002692079_00138_37767_5886.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_134256_000003122079_00139_37768_5884.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_152132_000005512079_00140_37769_6016.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_170008_000006122079_00141_37770_6140.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_184044_000005512079_00142_37771_6262.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_201941_000005932079_00143_37772_6387.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_220156_000004522079_00144_37773_6405.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20090521_234357_000002202079_00145_37774_6415.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

AUXILIARY FILES ANALYSIS completed

#####

MODULE STEPPING ANALYSIS

#####

Analysis will be performed from 2009-05-21 00:00:00 to 2009-05-21 23:59:59

Results will be exported to the directory: ./RESULTS/DAILY/090521/MODULE_STEPPING



Creating directory ./RESULTS/DAILY/090521/MODULE_STEPPING...
 Creating directory ./RESULTS/DAILY/090521/MODULE_STEPPING/FIRST_REFERENCE...
 Creating directory ./RESULTS/DAILY/090521/MODULE_STEPPING/SECOND_REFERENCE...
 Creating directory ./RESULTS/DAILY/090521/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...
 Deleting old files...

 Creating images comparing with second reference...

Exporting results to the directory ../../RESULTS/DAILY/090521/MODULE_STEPPING/SECOND_REFERENCE...

Polarization: H
 Reference product: ASA_MS__0PNPDK20050922_062651_00000152041_00034_18625_0041.N1
 Test product: ASA_MS__0PNPDK20090520_081846_00000162079_00121_37750_0813.N1
 H
 H

../../RESULTS/DAILY/090521/MODULE_STEPPING/SECOND_REFERENCE/TGH_20090520_081846-20050922_062651.png
 ../../RESULTS/DAILY/090521/MODULE_STEPPING/SECOND_REFERENCE/TPH_20090520_081846-20050922_062651.png
 ../../RESULTS/DAILY/090521/MODULE_STEPPING/SECOND_REFERENCE/RGH_20090520_081846-20050922_062651.png
 ../../RESULTS/DAILY/090521/MODULE_STEPPING/SECOND_REFERENCE/RPH_20090520_081846-20050922_062651.png

Polarization: V
 Reference product: ASA_MS__0PNPDK20050923_055514_00000152041_00048_18639_0042.N1
 Test product: ASA_MS__0PNPDK20090521_074709_00000162079_00135_37764_0814.N1
 V
 V

../../RESULTS/DAILY/090521/MODULE_STEPPING/SECOND_REFERENCE/TGV_20090521_074709-20050923_055514.png
 ../../RESULTS/DAILY/090521/MODULE_STEPPING/SECOND_REFERENCE/TPV_20090521_074709-20050923_055514.png
 ../../RESULTS/DAILY/090521/MODULE_STEPPING/SECOND_REFERENCE/RGV_20090521_074709-20050923_055514.png
 ../../RESULTS/DAILY/090521/MODULE_STEPPING/SECOND_REFERENCE/RPV_20090521_074709-20050923_055514.png

 Creating images comparing with previous product reference...

Exporting results to the directory ../../RESULTS/DAILY/090521/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Polarization: H
 Reference product: ASA_MS__0PNPDK20090518_092200_00000162079_00093_37722_0811.N1
 Test product: ASA_MS__0PNPDK20090520_081846_00000162079_00121_37750_0813.N1
 H
 H

../../RESULTS/DAILY/090521/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGH_20090520_081846-20090518_092200.png
 ../../RESULTS/DAILY/090521/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPH_20090520_081846-20090518_092200.png
 ../../RESULTS/DAILY/090521/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGH_20090520_081846-20090518_092200.png
 ../../RESULTS/DAILY/090521/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPH_20090520_081846-20090518_092200.png

Polarization: V
 Reference product: ASA_MS__0PNPDK20090519_085022_00000162079_00107_37736_0812.N1
 Test product: ASA_MS__0PNPDK20090521_074709_00000162079_00135_37764_0814.N1
 V
 V

../../RESULTS/DAILY/090521/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGV_20090521_074709-20090519_085022.png
 ../../RESULTS/DAILY/090521/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPV_20090521_074709-20090519_085022.png
 ../../RESULTS/DAILY/090521/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGV_20090521_074709-20090519_085022.png
 ../../RESULTS/DAILY/090521/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPV_20090521_074709-20090519_085022.png

MODULE_STEPPING ANALYSIS completed
 #####

CALIBRATION PULSES ANALYSIS
 #####
 Creating directory ./RESULTS/DAILY/090521/CALIBRATION_PULSES...

ALL ROWS Analysis will be performed from 2009-05-21 00:00:00 to 2009-05-21 23:59:59

Analysing products WVS IS2 V/V

Writing image ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Calibration_pulses_all_rows_WVS_IS2_VV.png...

Analysing products GM1 SS3 H/H

Writing image ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Calibration_pulses_all_rows_GM1_SS3_HH.png...

TEMPORAL EVOLUTION Analysis will be performed from 2009-05-21 00:00:00 to 2009-05-21 23:59:59

Analysing products WVS IS2 V/V

Getting calibration pulses data for WVS IS2 V/V from 2009-05-21 00:00:00 to 2009-05-21 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/090521/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-05-21_1.dat...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_1.png...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2009-05-21 00:00:00 to 2009-05-21 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/090521/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-05-21_2.dat...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_2.png...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2009-05-21 00:00:00 to 2009-05-21 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/090521/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-05-21_3.dat...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_3.png...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2009-05-21 00:00:00 to 2009-05-21 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/090521/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-05-21_4.dat...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_4.png...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_4.png...

Analysing products GM1 SS3 H/H

Getting calibration pulses data for GM1 SS3 H/H from 2009-05-21 00:00:00 to 2009-05-21 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/090521/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-05-21_1.dat...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_1.png...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_1.png...

Getting calibration pulses data for GM1 SS3 H/H from 2009-05-21 00:00:00 to 2009-05-21 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/090521/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-05-21_2.dat...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_2.png...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2009-05-21 00:00:00 to 2009-05-21 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/090521/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-05-21_3.dat...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_3.png...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2009-05-21 00:00:00 to 2009-05-21 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/090521/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-05-21_4.dat...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_4.png...

Writing ../.././RESULTS/DAILY/090521//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_4.png...

CALIBRATION PULSES ANALYSIS completed

#####

DOPPLER ANALYSIS

#####

Creating directory ./RESULTS/DAILY/090521/DOPPLER...

DOPPLER ANX Analysis will be performed from 2009-05-21 00:00:00 to 2009-05-21 23:59:59

Analysing products WVS IS2 V/V
Getting doppler data for WVS IS2 V/V from 2009-05-21 00:00:00 to 2009-05-21 23:59:59...
Writing file ./RESULTS/DAILY/090521/DOPPLER/Doppler_data_WVS_IS2_VV_2009-05-21.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/090521/DOPPLER/DOPPLER_ANX_WVS_IS2_VV.png...

Analysing products GM1 SS1 H/H
Getting doppler data for GM1 SS1 H/H from 2009-05-21 00:00:00 to 2009-05-21 23:59:59...
Writing file ./RESULTS/DAILY/090521/DOPPLER/Doppler_data_GM1_SS1_HH_2009-05-21.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/090521/DOPPLER/DOPPLER_ANX_GM1_SS1_HH.png...

DOPPLER JUMPS Analysis will be performed on WSM products from 2009-05-21 00:00:00 to 2009-05-21 23:59:59

Analysing by default products WSM
Getting doppler jumps data for WSM from 2009-05-21 00:00:00 to 2009-05-21 23:59:59...
Writing file ./RESULTS/DAILY/090521/DOPPLER/Doppler_Jumps_data_WSM_2009-05-21.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/090521/DOPPLER/DOPPLER_JUMPS_ANX_WSM.png...
Writing file ../../RESULTS/DAILY/090521/DOPPLER/DOPPLER_JUMPS_Date_WSM.png...

DOPPLER MAP Analysis will be performed from 2009-05-21 00:00:00 to 2009-05-21 23:59:59

Analysing products WVS IS2 V/V
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -28.825063 Hz
Writing file ../../RESULTS/DAILY/090521/DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_desc.jpg...
Writing file ../../RESULTS/DAILY/090521/DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_desc.jpg...

Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -23.384926 Hz
Writing file ../../RESULTS/DAILY/090521/DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_asc.jpg...
Writing file ../../RESULTS/DAILY/090521/DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_asc.jpg...

Analysing products GM1 SS1 H/H
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...

Mean error = -15.750129 Hz
Writing file ../../RESULTS/DAILY/090521//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_desc.jpg...
Writing file ../../RESULTS/DAILY/090521//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_desc.jpg...

Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -21.408110 Hz
Writing file ../../RESULTS/DAILY/090521//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_asc.jpg...
Writing file ../../RESULTS/DAILY/090521//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_asc.jpg...

DOPPLER ANALYSIS completed
#####

CHIRP ANALYSIS

Creating directory ./RESULTS/DAILY/090521/CHIRP...

CHIRP Analysis will be performed from 2009-05-21 00:00:00 to 2009-05-21 23:59:59

Analysing products WSM SS1 H/H

Getting ScaleFactor data for WSM SS1 H/H from 2009-05-21 00:00:00 to 2009-05-21 23:59:59...
Writing file ./RESULTS/DAILY/090521/CHIRP/ScaleFactor_data_WSM_SS1_HH_2009-05-21.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/090521/CHIRP/ScaleFactor_ANX_WSM_SS1_HH.png...
Writing file ../../RESULTS/DAILY/090521/CHIRP/ScaleFactor_DATE_WSM_SS1_HH.png...

Analysing products WSM SS1 V/V

Getting ScaleFactor data for WSM SS1 V/V from 2009-05-21 00:00:00 to 2009-05-21 23:59:59...
Writing file ./RESULTS/DAILY/090521/CHIRP/ScaleFactor_data_WSM_SS1_VV_2009-05-21.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/090521/CHIRP/ScaleFactor_ANX_WSM_SS1_VV.png...
Writing file ../../RESULTS/DAILY/090521/CHIRP/ScaleFactor_DATE_WSM_SS1_VV.png...

CHIRP ANALYSIS completed
#####

RAW DATA ANALYSIS

Analysis will be performed from 2009-05-21 00:00:00 to 2009-05-21 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/090521/RAW_DATA

Creating directory ./RESULTS/DAILY/090521/RAW_DATA...

Getting raw data for WVS from 2009-05-21 00:00:00 to 2009-05-21 23:59:59...
Writing file ./RESULTS/DAILY/090521/RAW_DATA/Raw_data_WVS_2009-05-21.dat...
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/090521/RAW_DATA/Raw_data_WVS_input_mean.png...

Creating image ../../RESULTS/DAILY/090521/RAW_DATA/Raw_data_WVS_input_stdev.png...
Creating image ../../RESULTS/DAILY/090521/RAW_DATA/Raw_data_WVS_gain_imbalance.png...

Getting raw data for IMM from 2009-05-21 00:00:00 to 2009-05-21 23:59:59...
Writing file ./RESULTS/DAILY/090521/RAW_DATA/Raw_data_IMM_2009-05-21.dat...
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/090521/RAW_DATA/Raw_data_IMM_input_mean.png...
Creating image ../../RESULTS/DAILY/090521/RAW_DATA/Raw_data_IMM_input_stdev.png...
Creating image ../../RESULTS/DAILY/090521/RAW_DATA/Raw_data_IMM_gain_imbalance.png...

RAW DATA ANALYSIS completed
#####

TELEMETRY ANALYSIS

Analysis will be performed from 2009-05-21 00:00:00 to 2009-05-21 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/090521/TELEMETRY

Creating directory ./RESULTS/DAILY/090521/TELEMETRY...

Looking for gaps and missing lines in WVS products...

Checking 27 products from PDE...
Checking 25 products from PDK...

Looking for gaps and missing lines in GM1 products...

Checking 32 products from PDE...
Checking 46 products from PDK...

Looking for gaps and missing lines in APM products...

Checking 3 products from PDE...
Checking 1 products from PDK...

Looking for gaps and missing lines in IMM products...

Checking 38 products from PDE...
Checking 4 products from PDK...

Looking for gaps and missing lines in WSM products...

Checking 81 products from PDE...
Found product...ASA_WSM_1PNPDE20090521_032321_00000732079_00133_37762_4941.N1 / 0 gaps / 34 missing lines
Found product...ASA_WSM_1PNPDE20090521_032321_000002252079_00133_37762_5133.N1 / 0 gaps / 34 missing lines
Found product...ASA_WSM_1PNPDE20090521_182807_00000922079_00142_37771_5609.N1 / 0 gaps / 70 missing lines
Checking 16 products from PDK...

Creating graph of missing lines and gaps...

Creating image: ./RESULTS/DAILY/090521/TELEMETRY/TELEMETRY_Missing_lines.png...
Creating image: ./RESULTS/DAILY/090521/TELEMETRY/TELEMETRY_Gaps.png...

TELEMETRY ANALYSIS completed
#####

BROWSE PRODUCTS ANALYSIS

Analysis will be performed on 2009-05-21

Scanning directory /nas3/ENVISAT/ASAR//ASA_GM_BP...
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_GM_BP/JPG/20090521/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_013100_000005072079_00131_37760_4691.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_015157_000004102079_00132_37761_4693.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_015945_000002592079_00132_37761_4699.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_021136_000003082079_00132_37761_4697.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_021817_000000842079_00132_37761_4695.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_022044_000000962079_00132_37761_4712.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_024522_000000722079_00132_37761_4875.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_025057_000006282079_00132_37761_4931.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_030554_000001692079_00132_37761_4867.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_030846_000007432079_00132_37761_4863.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_032712_000007122079_00133_37762_4861.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_033955_000002172079_00133_37762_4856.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_034706_000005252079_00133_37762_4851.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_042558_000009302079_00133_37762_5107.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_050358_000003022079_00134_37763_5105.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_051119_000001932079_00134_37763_5089.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_051534_000005732079_00134_37763_5087.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_053130_000003682079_00134_37763_5091.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_202941_000002952079_00143_37772_5638.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_203715_000000782079_00143_37772_5640.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_211158_000005012079_00143_37772_5648.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_212551_000001262079_00143_37772_5655.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_214605_000005072079_00144_37773_6249.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_220934_000004712079_00144_37773_5821.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_225722_000001692079_00144_37773_5819.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_230553_000001632079_00144_37773_6251.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20090521_234932_000007312079_00145_37774_5963.N1 ...

ANALYSIS COMPLETED: 27 GM browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_AP_BP...
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_AP_BP/JPG/20090521/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_AP_BP/ASA_AP_BPZPDE20090521_021002_000000742079_00132_37761_4799.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_AP_BP/ASA_AP_BPZPDE20090521_021941_000000402079_00132_37761_4790.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_AP_BP/ASA_AP_BPZPDE20090521_091042_000000432079_00136_37765_5192.N1 ...

ANALYSIS COMPLETED: 3 AP browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_IM_BP...
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_IM_BP/JPG/20090521/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_001453_000002022079_00131_37760_4674.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_011221_000002112079_00131_37760_4666.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_015848_000000462079_00132_37761_4682.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_021644_000000822079_00132_37761_4821.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_033905_000000382079_00133_37762_4865.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_035552_000003912079_00133_37762_4974.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_050859_000001282079_00134_37763_4992.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_051431_000000502079_00134_37763_4972.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_053735_000002352079_00134_37763_5071.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_055115_000000532079_00134_37763_4976.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_071801_000000372079_00135_37764_5109.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_072531_000000622079_00135_37764_5136.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_072531_000000812079_00135_37764_5196.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_123224_000000812079_00138_37767_5315.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_123224_000000812079_00138_37767_5317.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_145311_000000372079_00139_37768_5391.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_164412_000000772079_00141_37770_5441.N1 ...



```
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_165232_000000472079_00141_37770_5405.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_171219_000000402079_00141_37770_5431.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_180320_000000982079_00141_37770_5437.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_194107_000000632079_00142_37771_5508.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_194107_000000632079_00142_37771_5612.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_194107_000000632079_00142_37771_5668.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_194107_000002652079_00142_37771_6199.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_194310_000000602079_00142_37771_5672.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_194411_000000592079_00142_37771_5514.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_212016_000003242079_00143_37772_6253.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_212219_000001192079_00143_37772_5831.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_215429_000000632079_00144_37773_5753.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_215429_000000682079_00144_37773_6201.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_222019_000000592079_00144_37773_5911.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_230008_000003342079_00144_37773_5952.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_232948_000000532079_00145_37774_5991.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090521_233604_000000532079_00145_37774_5913.N1 ...
```

ANALYSIS COMPLETED: 34 IM browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_WS_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_WS_BP/JPG/20090521/

```
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_001318_000000672079_00131_37760_4633.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_002526_000000732079_00131_37760_4655.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_002526_000001892079_00131_37760_4823.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_020409_000003302079_00132_37761_4950.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_020623_000000552079_00132_37761_4813.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_020921_000000182079_00132_37761_4819.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_022723_000001162079_00132_37761_4788.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_024637_000002502079_00132_37761_4825.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_032321_000000732079_00133_37762_4942.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_032321_000002252079_00133_37762_5134.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_034337_000000732079_00133_37762_4933.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_034337_000001892079_00133_37762_5157.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_052511_000002502079_00134_37763_5159.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_052511_000003732079_00134_37763_5229.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_060911_000000982079_00134_37763_5076.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_070513_000000912079_00135_37764_5179.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_070626_000000182079_00135_37764_5113.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_072105_000002132079_00135_37764_5171.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_073752_000002692079_00135_37764_5194.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_093401_000000732079_00136_37765_5350.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_093401_000000732079_00136_37765_5765.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_093401_000001342079_00136_37765_5375.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_093401_000005312079_00136_37765_5439.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_093514_000000612079_00136_37765_6286.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_093615_000003552079_00136_37765_5915.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_093710_000000612079_00136_37765_5356.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_093811_000001232079_00136_37765_6421.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_093913_000000612079_00136_37765_5329.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_093913_000001212079_00136_37765_5373.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_094014_000001572079_00136_37765_5632.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_094115_000000552079_00136_37765_6298.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_094210_000000422079_00136_37765_5366.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_094322_000001032079_00136_37765_5313.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_094322_000001032079_00136_37765_5348.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_103654_000000732079_00137_37766_5293.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_103654_000000912079_00137_37766_5311.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_103654_000000912079_00137_37766_5368.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_111040_000001892079_00137_37766_5423.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_111040_000001892079_00137_37766_5598.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_111153_000000612079_00137_37766_5343.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_111254_000000552079_00137_37766_5277.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_111658_000000732079_00137_37766_5283.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_111658_000000732079_00137_37766_5622.N1 ...
```




```

Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_111658_000002692079_00137_37766_5379.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_112008_000000612079_00137_37766_5628.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_112008_000000782079_00137_37766_6308.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_112109_000000182079_00137_37766_5305.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_115820_000000732079_00138_37767_5253.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_115820_000000732079_00138_37767_5257.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_115820_000000732079_00138_37767_5538.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_115820_000000732079_00138_37767_5594.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_115820_000000732079_00138_37767_5600.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_115820_000000732079_00138_37767_5634.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_115820_000000732079_00138_37767_6212.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_135436_000001352079_00139_37768_5520.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_141400_000000922079_00139_37768_5421.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_150950_000001892079_00140_37769_5425.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_150950_000002502079_00140_37769_5490.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_153116_000001102079_00140_37769_5492.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_161946_000001532079_00140_37769_5419.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_165022_000001352079_00141_37770_5518.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_165136_000000612079_00141_37770_5409.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_171400_000002082079_00141_37770_5471.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_175501_000001902079_00141_37770_5486.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_175501_000002262079_00141_37770_5592.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_182807_000000922079_00142_37771_5610.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_182905_000001342079_00142_37771_5494.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_183326_000000972079_00142_37771_5488.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_183541_000000732079_00142_37771_5463.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_183541_000000912079_00142_37771_5476.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_193341_000001342079_00142_37771_5580.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_193341_000001652079_00142_37771_5761.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_195839_000000732079_00142_37771_5542.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_195839_000000732079_00142_37771_5642.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_195839_000001762079_00142_37771_6206.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_203441_000000732079_00143_37772_5744.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_203441_000001532079_00143_37772_6236.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_213251_000000912079_00143_37772_5763.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_213559_000000732079_00143_37772_5783.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_213712_000001172079_00143_37772_6425.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_215757_000000922079_00144_37773_5803.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_225248_000000732079_00144_37773_5932.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_234206_000000732079_00145_37774_6068.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090521_234702_000001352079_00145_37774_6081.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDK20090521_201941_000005932079_00143_37772_6388.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDK20090521_220156_000004522079_00144_37773_6406.N1 ...

```

ANALYSIS COMPLETED: 86 WS browse products to see...

BROWSE PRODUCTS ANALYSIS completed
 #####

HTML REPORT generation
 #####

```

Building file ./RESULTS/DAILY/090521/asarReport.html...
Building DATA SUMMARY section...
Building AUXILIARY FILES ANALYSIS section...
Building MODULE STEPPING ANALYSIS section...
Building CALIBRATION PULSES ANALYSIS section...
Building DOPPLER ANALYSIS section...
Building CHIRP ANALYSIS section...
Building RAW DATA ANALYSIS section...
Building TELEMETRY ANALYSIS section...

```

HTML REPORT generation completed

#####



ASAR Daily Report



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20090521_021002_000000742079_00132_37761_4798.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20090521_021941_000000402079_00132_37761_4789.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20090521_091042_000000432079_00136_37765_5191.N1	OK	OK	OK	OK
ASA_APM_1PNPDK20090521_133925_000000412079_00139_37768_5853.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20090521_002102_000002592079_00131_37760_4538.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_002900_000001322079_00131_37760_4540.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_005106_000003922079_00131_37760_4553.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_010851_000002112079_00131_37760_4551.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_011604_000002832079_00131_37760_4563.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_013100_000005072079_00131_37760_4690.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_015157_000004102079_00132_37761_4692.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_015945_000002592079_00132_37761_4698.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_021136_000003082079_00132_37761_4696.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_021817_000000842079_00132_37761_4694.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_022044_000000962079_00132_37761_4711.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_024522_000000722079_00132_37761_4874.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_025057_000006282079_00132_37761_4930.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_030554_000001692079_00132_37761_4866.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_030846_000007432079_00132_37761_4862.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_032712_000007122079_00133_37762_4860.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_033955_000002172079_00133_37762_4855.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_034706_000005252079_00133_37762_4850.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_042558_000009302079_00133_37762_5106.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_050358_000003022079_00134_37763_5104.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_051119_000001932079_00134_37763_5088.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_051534_000005732079_00134_37763_5086.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_053130_000003682079_00134_37763_5090.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_202941_000002952079_00143_37772_5637.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_203715_000000782079_00143_37772_5639.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_211158_000005012079_00143_37772_5647.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_212551_000001262079_00143_37772_5654.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_214605_000005072079_00144_37773_6248.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_220934_000004712079_00144_37773_5820.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_225722_000001692079_00144_37773_5818.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_230553_000001632079_00144_37773_6250.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090521_234932_000007312079_00145_37774_5962.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_060634_000001502079_00134_37763_5246.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_061052_000007062079_00134_37763_5251.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_065601_000005492079_00135_37764_5259.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_071539_000001442079_00135_37764_5324.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_071849_000001322079_00135_37764_5326.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_072703_000006462079_00135_37764_5328.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_074827_000008882079_00135_37764_5336.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_083820_000004042079_00136_37765_5341.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_090434_000003682079_00136_37765_5469.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_092746_000003682079_00136_37765_5474.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_101751_000004282079_00137_37766_5532.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_104303_000003562079_00137_37766_5612.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_110822_000001322079_00137_37766_5610.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_111358_000001752079_00137_37766_5614.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_112132_000001752079_00137_37766_5619.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_115954_000002592079_00138_37767_5685.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_123357_000004532079_00138_37767_5750.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_125355_000006642079_00138_37767_5758.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_131047_000004772079_00138_37767_5760.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_133248_000003982079_00139_37768_5762.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_134028_000001442079_00139_37768_5769.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_134822_000003682079_00139_37768_5888.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_140934_000002592079_00139_37768_5890.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_141534_000002172079_00139_37768_5895.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_142934_000009302079_00139_37768_5900.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_145359_000001442079_00139_37768_5905.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_150512_000002712079_00140_37769_5907.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_151422_000004282079_00140_37769_5971.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_153310_000007062079_00140_37769_6021.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_154710_000001442079_00140_37769_6023.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_161010_000005732079_00140_37769_6025.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_162220_000002292079_00140_37769_6030.N1					OK	OK	OK	OK

ASA_GM1_1PNPDK20090521_164553_000002652079_00141_37770_6032.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_165331_000003922079_00141_37770_6042.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_171021_000001202079_00141_37770_6142.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_171734_000005252079_00141_37770_6144.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_175046_000002532079_00141_37770_6147.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_175856_000002652079_00141_37770_6149.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_180508_000001022079_00141_37770_6151.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_183122_000001202079_00142_37771_6156.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_183858_000001022079_00142_37771_6166.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_185009_000005792079_00142_37771_6264.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_193122_000001322079_00142_37771_6266.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_193631_000002772079_00142_37771_6268.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_194542_000001022079_00142_37771_6270.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090521_200142_000006942079_00142_37771_6275.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_IMM_1PNPDE20090521_001453_000000632079_00131_37760_4644.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_001453_000002022079_00131_37760_4673.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_001756_000000192079_00131_37760_4650.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_011221_000000632079_00131_37760_4636.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_011221_000002112079_00131_37760_4665.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_011524_000000282079_00131_37760_4642.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_015848_000000462079_00132_37761_4681.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_021644_000000822079_00132_37761_4820.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_033905_000000382079_00133_37762_4864.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_035552_000003912079_00133_37762_4973.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_050859_000001282079_00134_37763_4991.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_051431_000000502079_00134_37763_4971.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_053735_000002352079_00134_37763_5070.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_055115_000000532079_00134_37763_4975.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_071801_000000372079_00135_37764_5108.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_072531_000000622079_00135_37764_5135.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_072531_000000812079_00135_37764_5195.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_123224_000000812079_00138_37767_5314.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_123224_000000812079_00138_37767_5316.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_145311_000000372079_00139_37768_5390.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_164412_000000772079_00141_37770_5440.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_165232_000000472079_00141_37770_5404.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_171219_000000402079_00141_37770_5430.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_180320_000000982079_00141_37770_5436.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_194107_000000632079_00142_37771_5507.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_194107_000000632079_00142_37771_5611.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_194107_000000632079_00142_37771_5667.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_194107_000002652079_00142_37771_6198.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_194310_000000602079_00142_37771_5671.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_194411_000000592079_00142_37771_5513.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_212016_000003242079_00143_37772_6252.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_212219_000001192079_00143_37772_5830.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_215429_000000632079_00144_37773_5752.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_215429_000000682079_00144_37773_6200.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_222019_000000592079_00144_37773_5910.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_230008_000003342079_00144_37773_5951.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_232948_000000532079_00145_37774_5990.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20090521_233604_000000532079_00145_37774_5912.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20090521_071107_000002622079_00135_37764_5317.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20090521_082515_000000442079_00136_37765_5415.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20090521_085514_000001712079_00136_37765_5450.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20090521_201708_000001152079_00143_37772_6356.N1					OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.


Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WSM_1PNPDE20090521_001318_000000672079_00131_37760_4632.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_002526_000000732079_00131_37760_4654.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_002526_000001892079_00131_37760_4822.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_010529_000001892079_00131_37760_4660.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_020409_000003302079_00132_37761_4949.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_020623_000000552079_00132_37761_4812.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_020921_000000182079_00132_37761_4818.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_022723_000001162079_00132_37761_4787.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_024637_000002502079_00132_37761_4824.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_032321_000000732079_00133_37762_4941.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_032321_000002252079_00133_37762_5133.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_034337_000000732079_00133_37762_4932.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_034337_000001892079_00133_37762_5156.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_052511_000002502079_00134_37763_5158.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_052511_000003732079_00134_37763_5228.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_060911_000000982079_00134_37763_5075.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_070513_000000912079_00135_37764_5178.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_070626_000000182079_00135_37764_5112.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_072105_000002132079_00135_37764_5170.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_073752_000002692079_00135_37764_5193.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_093401_000000732079_00136_37765_5349.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_093401_000000732079_00136_37765_5764.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_093401_000001342079_00136_37765_5374.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_093401_000005312079_00136_37765_5438.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_093514_000000612079_00136_37765_6285.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_093615_000003552079_00136_37765_5914.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_093710_000000612079_00136_37765_5355.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_093811_000001232079_00136_37765_6420.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_093913_000000612079_00136_37765_5328.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_093913_000001212079_00136_37765_5372.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_094014_000001572079_00136_37765_5631.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_094210_000000422079_00136_37765_5365.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_094322_000001032079_00136_37765_5312.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_094322_000001032079_00136_37765_5347.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_103654_000000732079_00137_37766_5292.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_103654_000000912079_00137_37766_5310.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_103654_000000912079_00137_37766_5367.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_111040_000001892079_00137_37766_5422.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_111040_000001892079_00137_37766_5597.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_111153_000000612079_00137_37766_5342.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_111254_000000552079_00137_37766_5276.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_111658_000000732079_00137_37766_5282.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_111658_000000732079_00137_37766_5621.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_111658_000002692079_00137_37766_5378.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_112008_000000612079_00137_37766_5627.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_112109_000000182079_00137_37766_5304.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5252.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5256.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5537.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5593.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5599.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5633.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_6211.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_135436_000001352079_00139_37768_5519.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_150950_000001892079_00140_37769_5424.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_150950_000002502079_00140_37769_5489.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_153116_000001102079_00140_37769_5491.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_161946_000001532079_00140_37769_5418.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_165022_000001352079_00141_37770_5517.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_165136_000000612079_00141_37770_5408.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_171400_000002082079_00141_37770_5470.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_175501_000001902079_00141_37770_5485.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_175501_000002262079_00141_37770_5591.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_182807_000000922079_00142_37771_5609.N1					OK	OK	OK	OK

ASA_WSM_1PNPDE20090521_182905_000001342079_00142_37771_5493.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_183326_000000972079_00142_37771_5487.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_183541_000000732079_00142_37771_5462.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_183541_000000912079_00142_37771_5475.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_193341_000001342079_00142_37771_5579.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_193341_000001652079_00142_37771_5760.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_195839_000000732079_00142_37771_5541.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_195839_000000732079_00142_37771_5641.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_195839_000001762079_00142_37771_6205.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_203441_000000732079_00143_37772_5743.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_203441_000001532079_00143_37772_6235.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_213251_000000912079_00143_37772_5762.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_213559_000000732079_00143_37772_5782.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_215757_000000922079_00144_37773_5802.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_225248_000000732079_00144_37773_5931.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_234206_000000732079_00145_37774_6067.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20090521_234702_000001352079_00145_37774_6080.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_052654_000002132079_00134_37763_5601.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_070611_000002872079_00135_37764_5321.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_084510_000002862079_00136_37765_5461.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_085051_000002512079_00136_37765_5463.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_102506_000005512079_00137_37766_5605.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_103647_000000732079_00137_37766_5561.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_120419_000000922079_00138_37767_5710.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_120622_000005202079_00138_37767_5745.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_124920_000002692079_00138_37767_5886.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_134256_000003122079_00139_37768_5884.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_152132_000005512079_00140_37769_6016.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_170008_000006122079_00141_37770_6140.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_184044_000005512079_00142_37771_6262.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_201941_000005932079_00143_37772_6387.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_220156_000004522079_00144_37773_6405.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20090521_234357_000002202079_00145_37774_6415.N1	OK	OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20090521_003117_000011442079_00131_37760_4546.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_005738_000003902079_00131_37760_4549.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_012051_000002702079_00131_37760_4561.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_012436_000003452079_00131_37760_4688.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_013931_000007042079_00132_37761_4704.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_022228_000002542079_00132_37761_4701.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_022920_000008242079_00132_37761_4714.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_024235_000001202079_00132_37761_4872.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_030127_000002252079_00132_37761_4869.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_032115_000000892079_00133_37762_4853.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_040310_000009892079_00133_37762_4858.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_041909_000001202079_00133_37762_5115.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_042412_000000602079_00133_37762_5102.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_044203_000012742079_00133_37762_5099.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_054228_000004942079_00134_37763_5123.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_055213_000004792079_00134_37763_5084.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_203838_000019492079_00143_37772_5657.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_212802_000002402079_00143_37772_5660.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_213421_000000442079_00143_37772_6246.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_214033_000002842079_00143_37772_5808.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_215929_000001052079_00144_37773_5811.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_221728_000001352079_00144_37773_5814.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_230838_000003152079_00144_37773_5828.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_231308_000009592079_00144_37773_5957.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_233046_000002842079_00145_37774_5954.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090521_233702_000002552079_00145_37774_5960.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_055958_000003452079_00134_37763_5249.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_062239_000019642079_00134_37763_5268.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_074223_000002402079_00135_37764_5331.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_080315_000012892079_00135_37764_5334.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_082606_000006892079_00136_37765_5339.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_091131_000009292079_00136_37765_5472.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_094508_000019192079_00136_37765_5482.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_103425_000001052079_00137_37766_5608.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_104902_000011092079_00137_37766_5617.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_112427_000019492079_00137_37766_5700.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_121501_000010042079_00138_37767_5748.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_124133_000004052079_00138_37767_5753.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_130503_000003002079_00138_37767_5756.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_131843_000007272079_00138_37767_5784.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_135655_000007192079_00139_37768_5893.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_141915_000005702079_00139_37768_5898.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_144538_000003752079_00139_37768_5903.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_145628_000004792079_00139_37768_5969.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_154458_000000892079_00140_37769_6019.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_154934_000011842079_00140_37769_6028.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_162614_000010342079_00140_37769_6035.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_172624_000014242079_00141_37770_6154.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_181023_000010192079_00141_37770_6159.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_185952_000018442079_00142_37771_6273.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090521_194726_000006302079_00142_37771_6278.N1					OK	OK	OK	OK


Calibration pulses for GM1 SS3 H/H

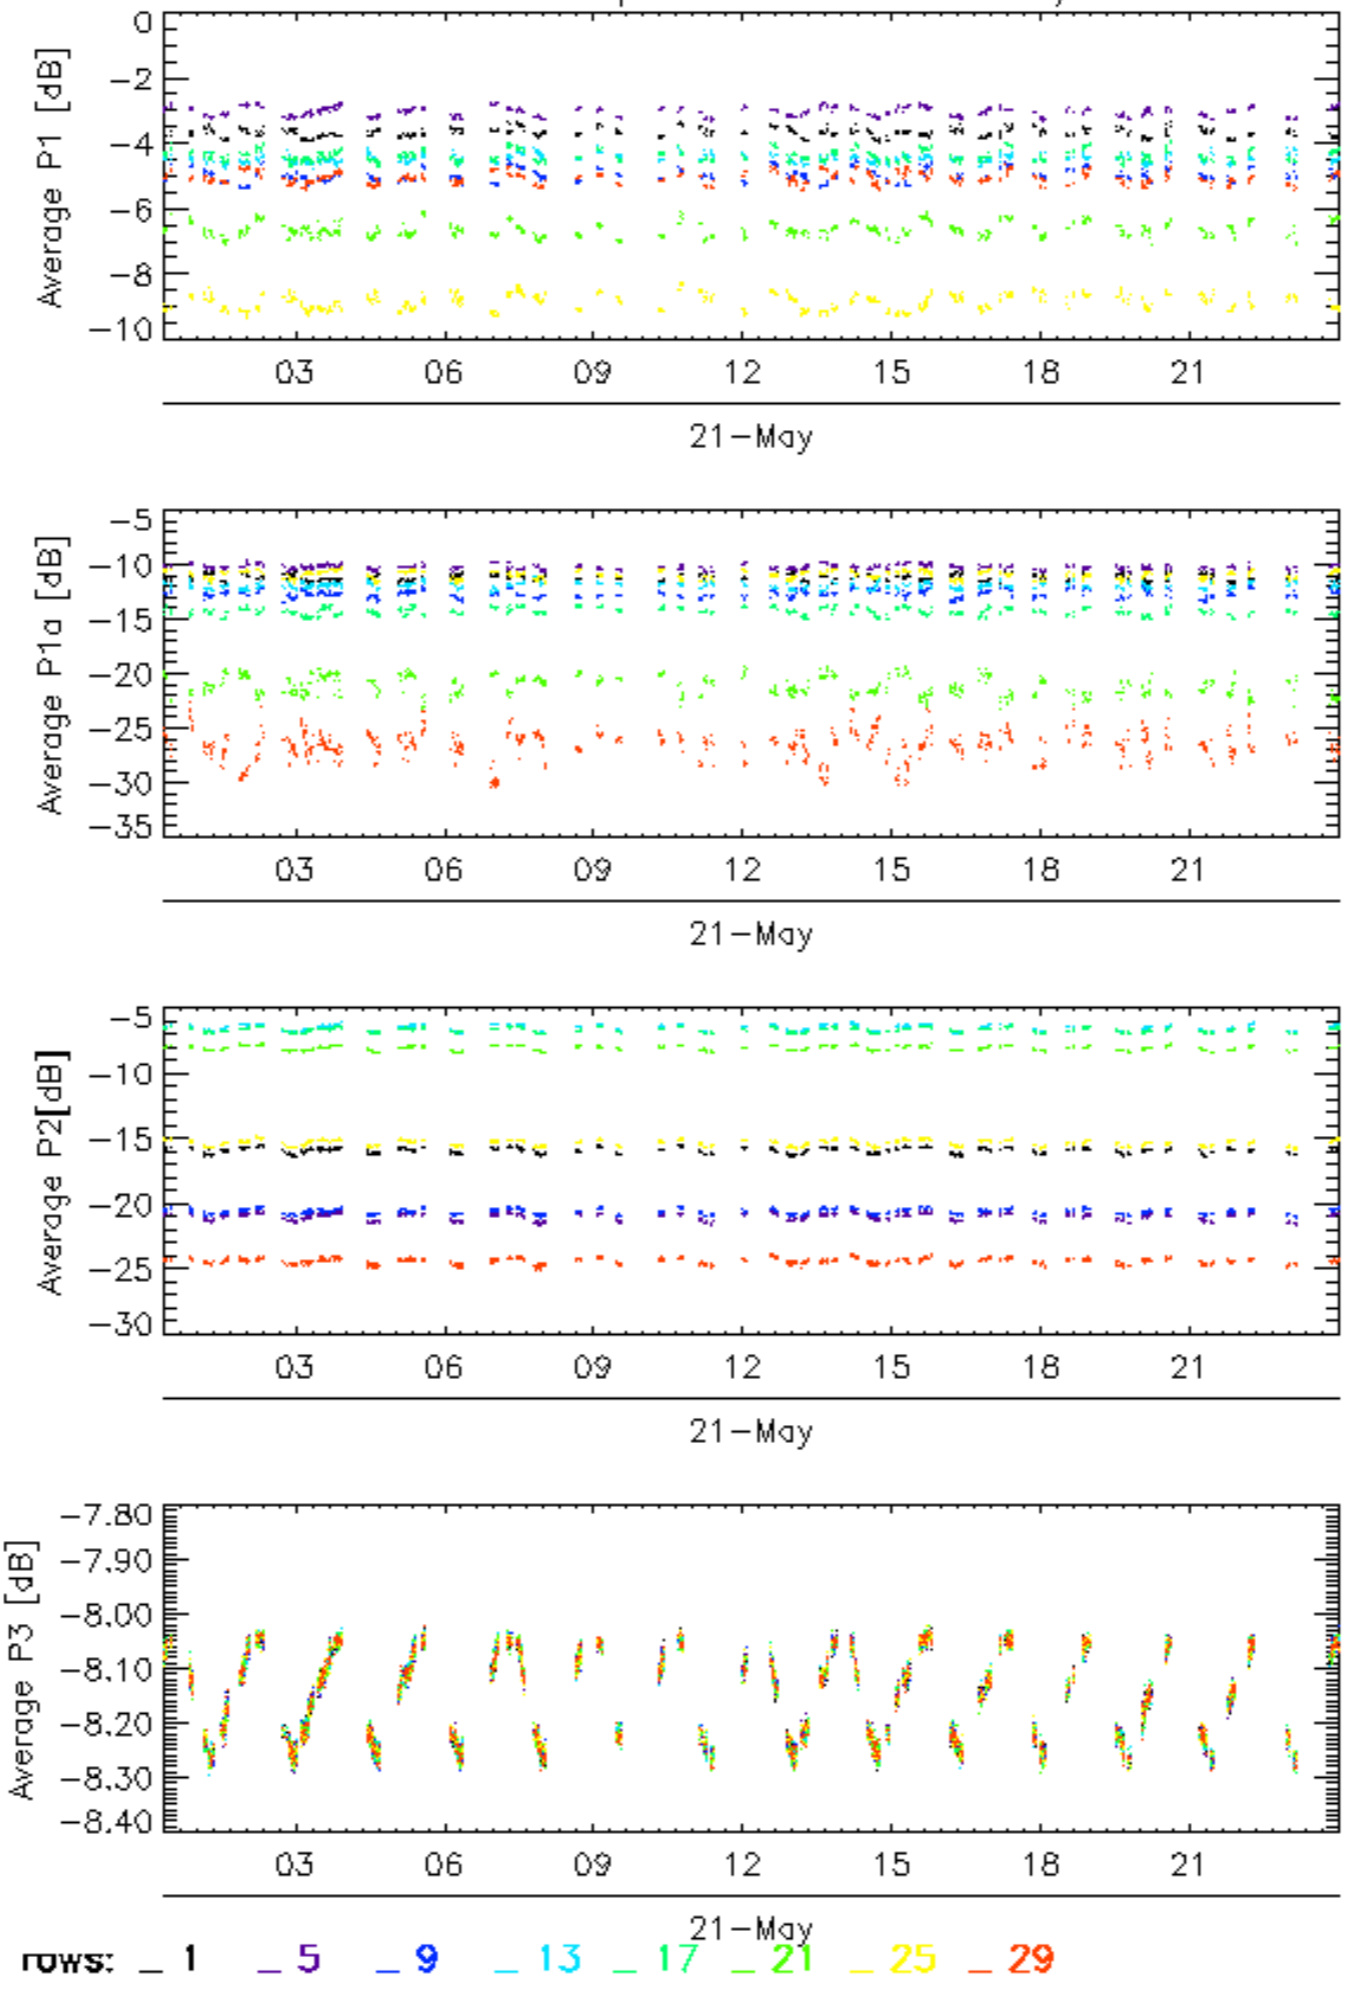


Calibration pulses for GM1 SS3 H/H

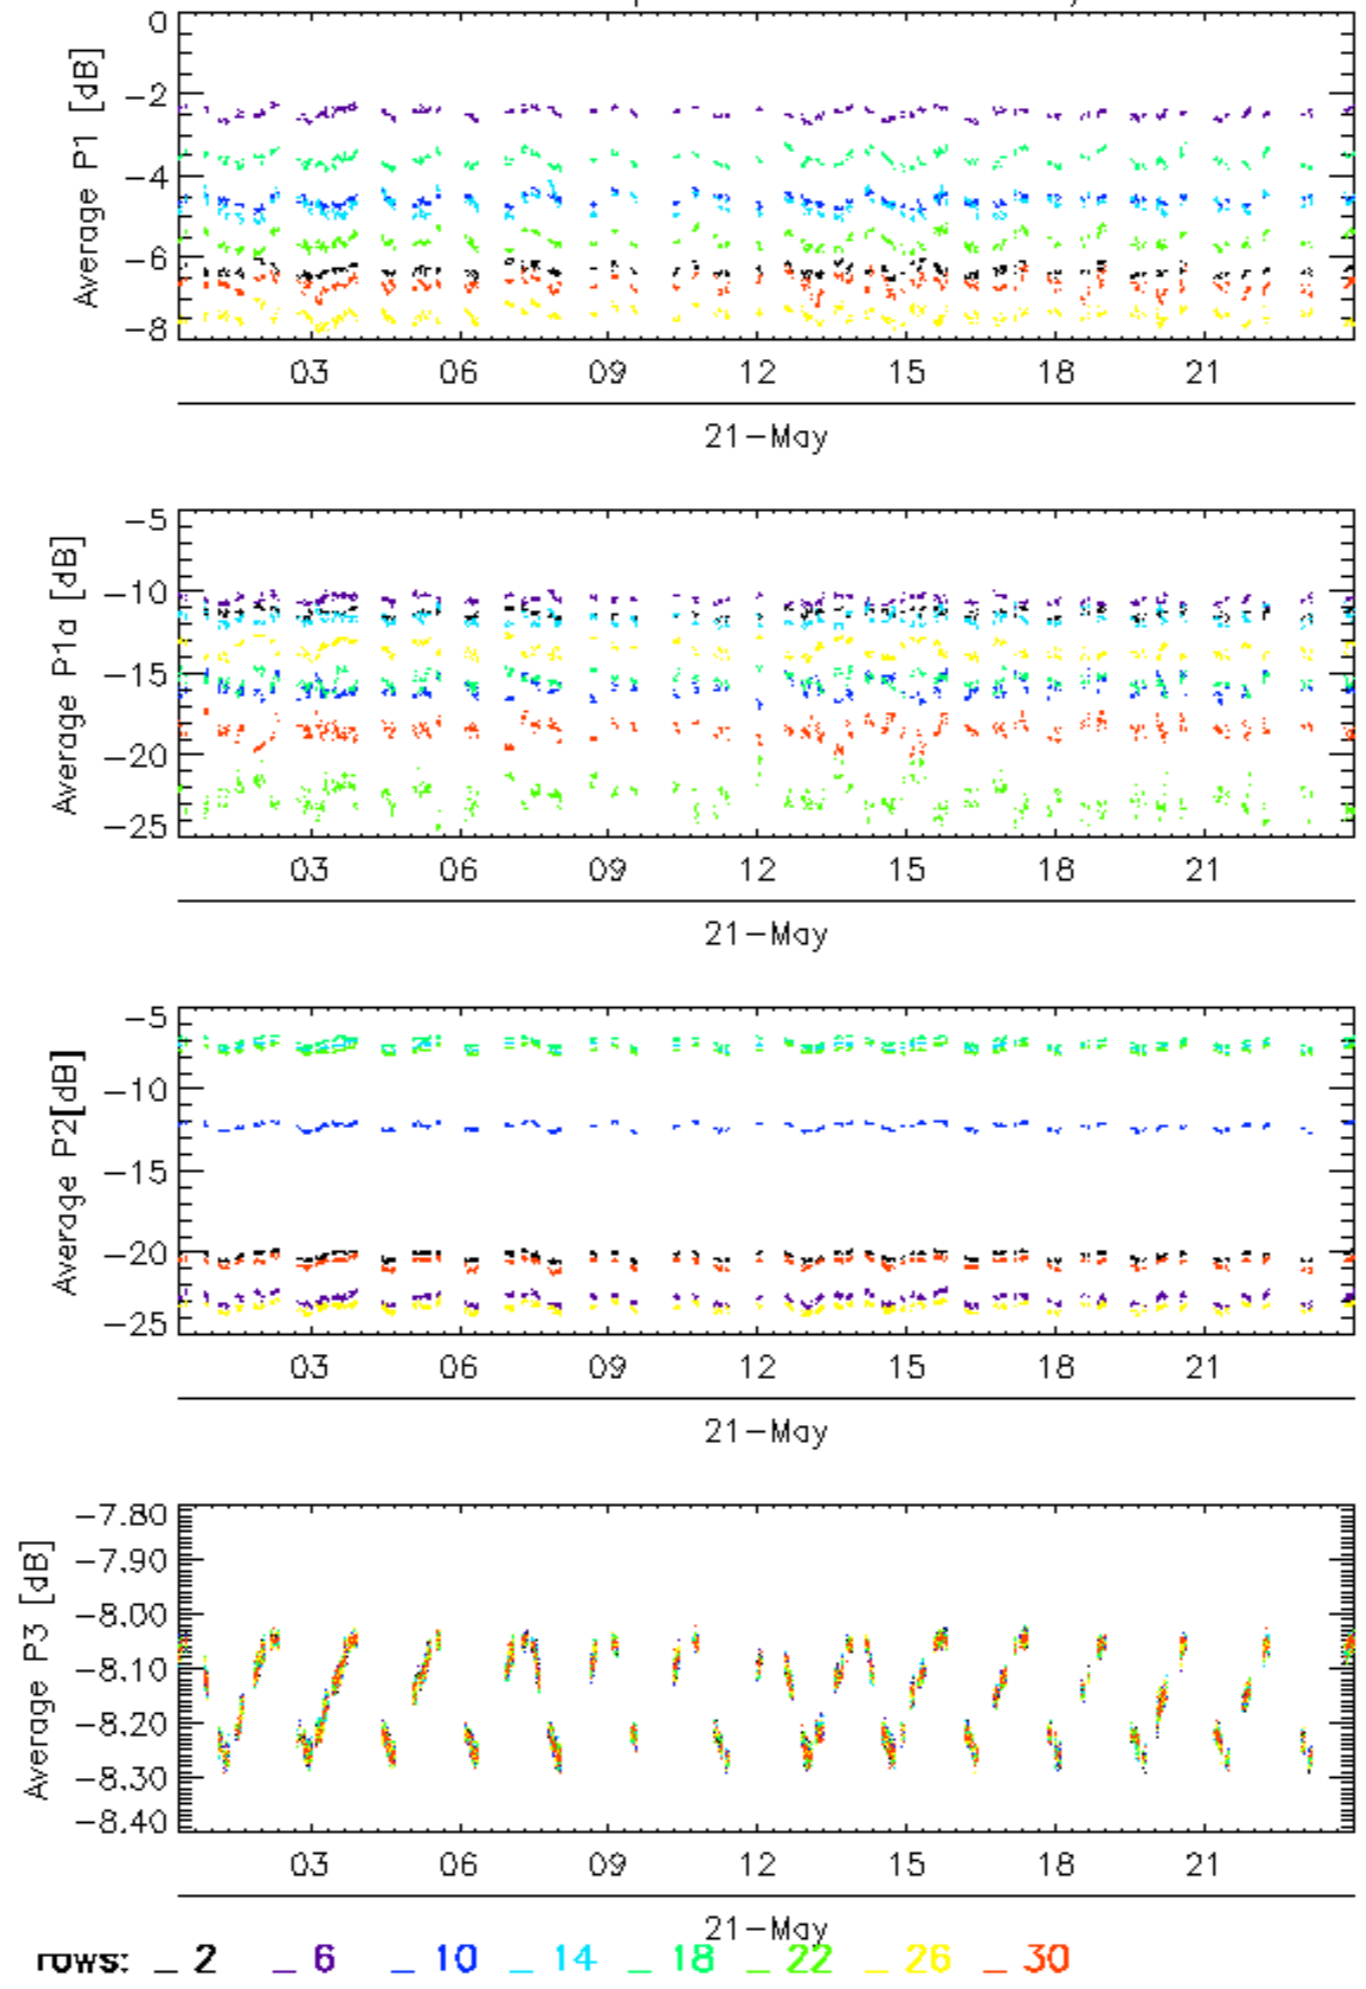


Calibration pulses for GM1 SS3 H/H

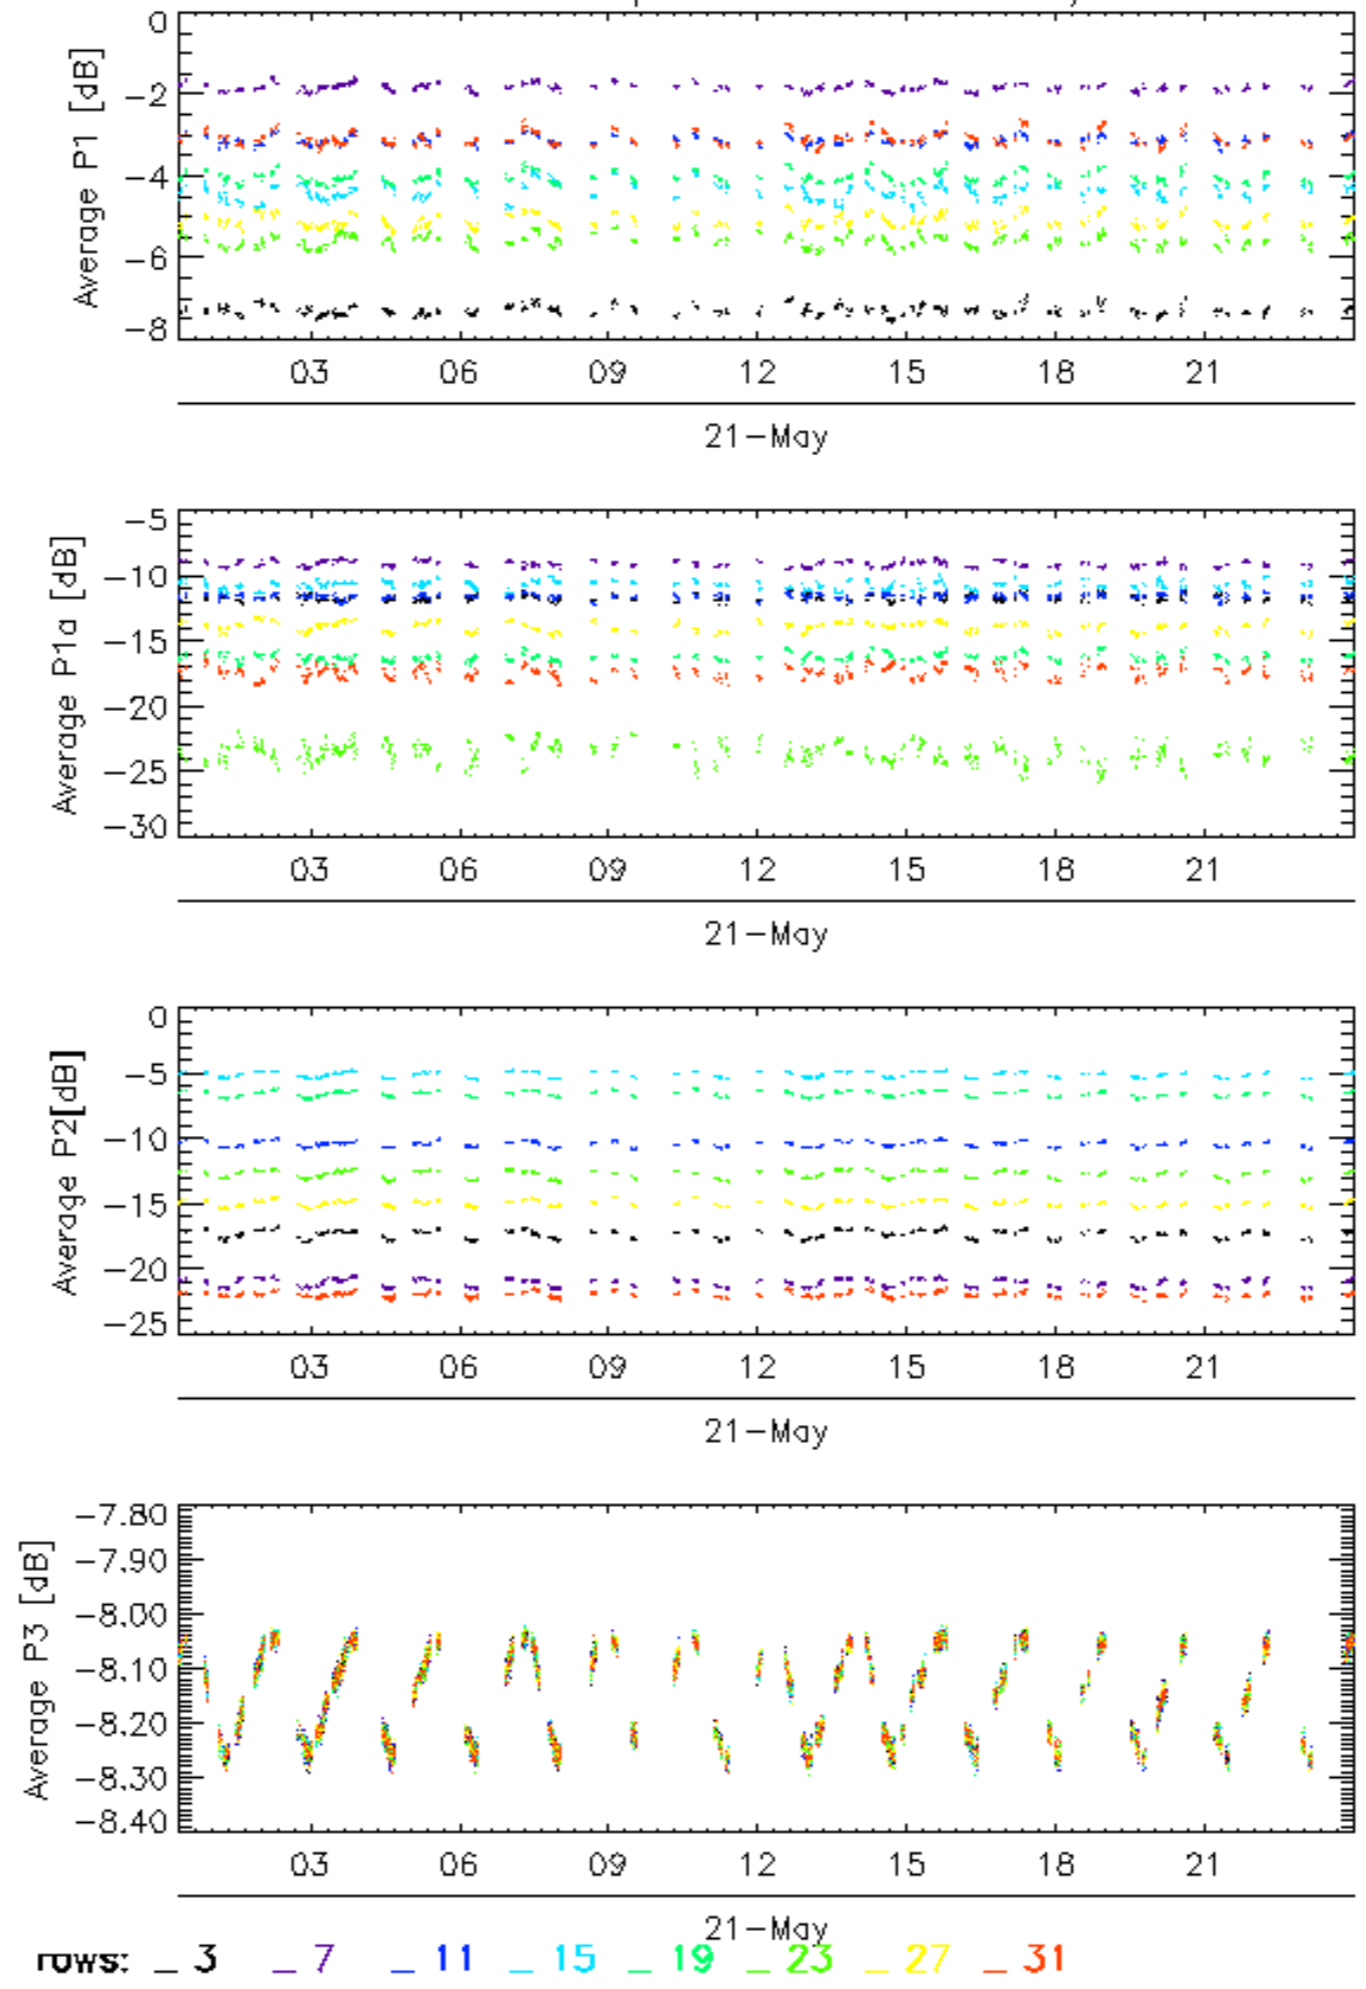


Calibration pulses for GM1 SS3 H/H

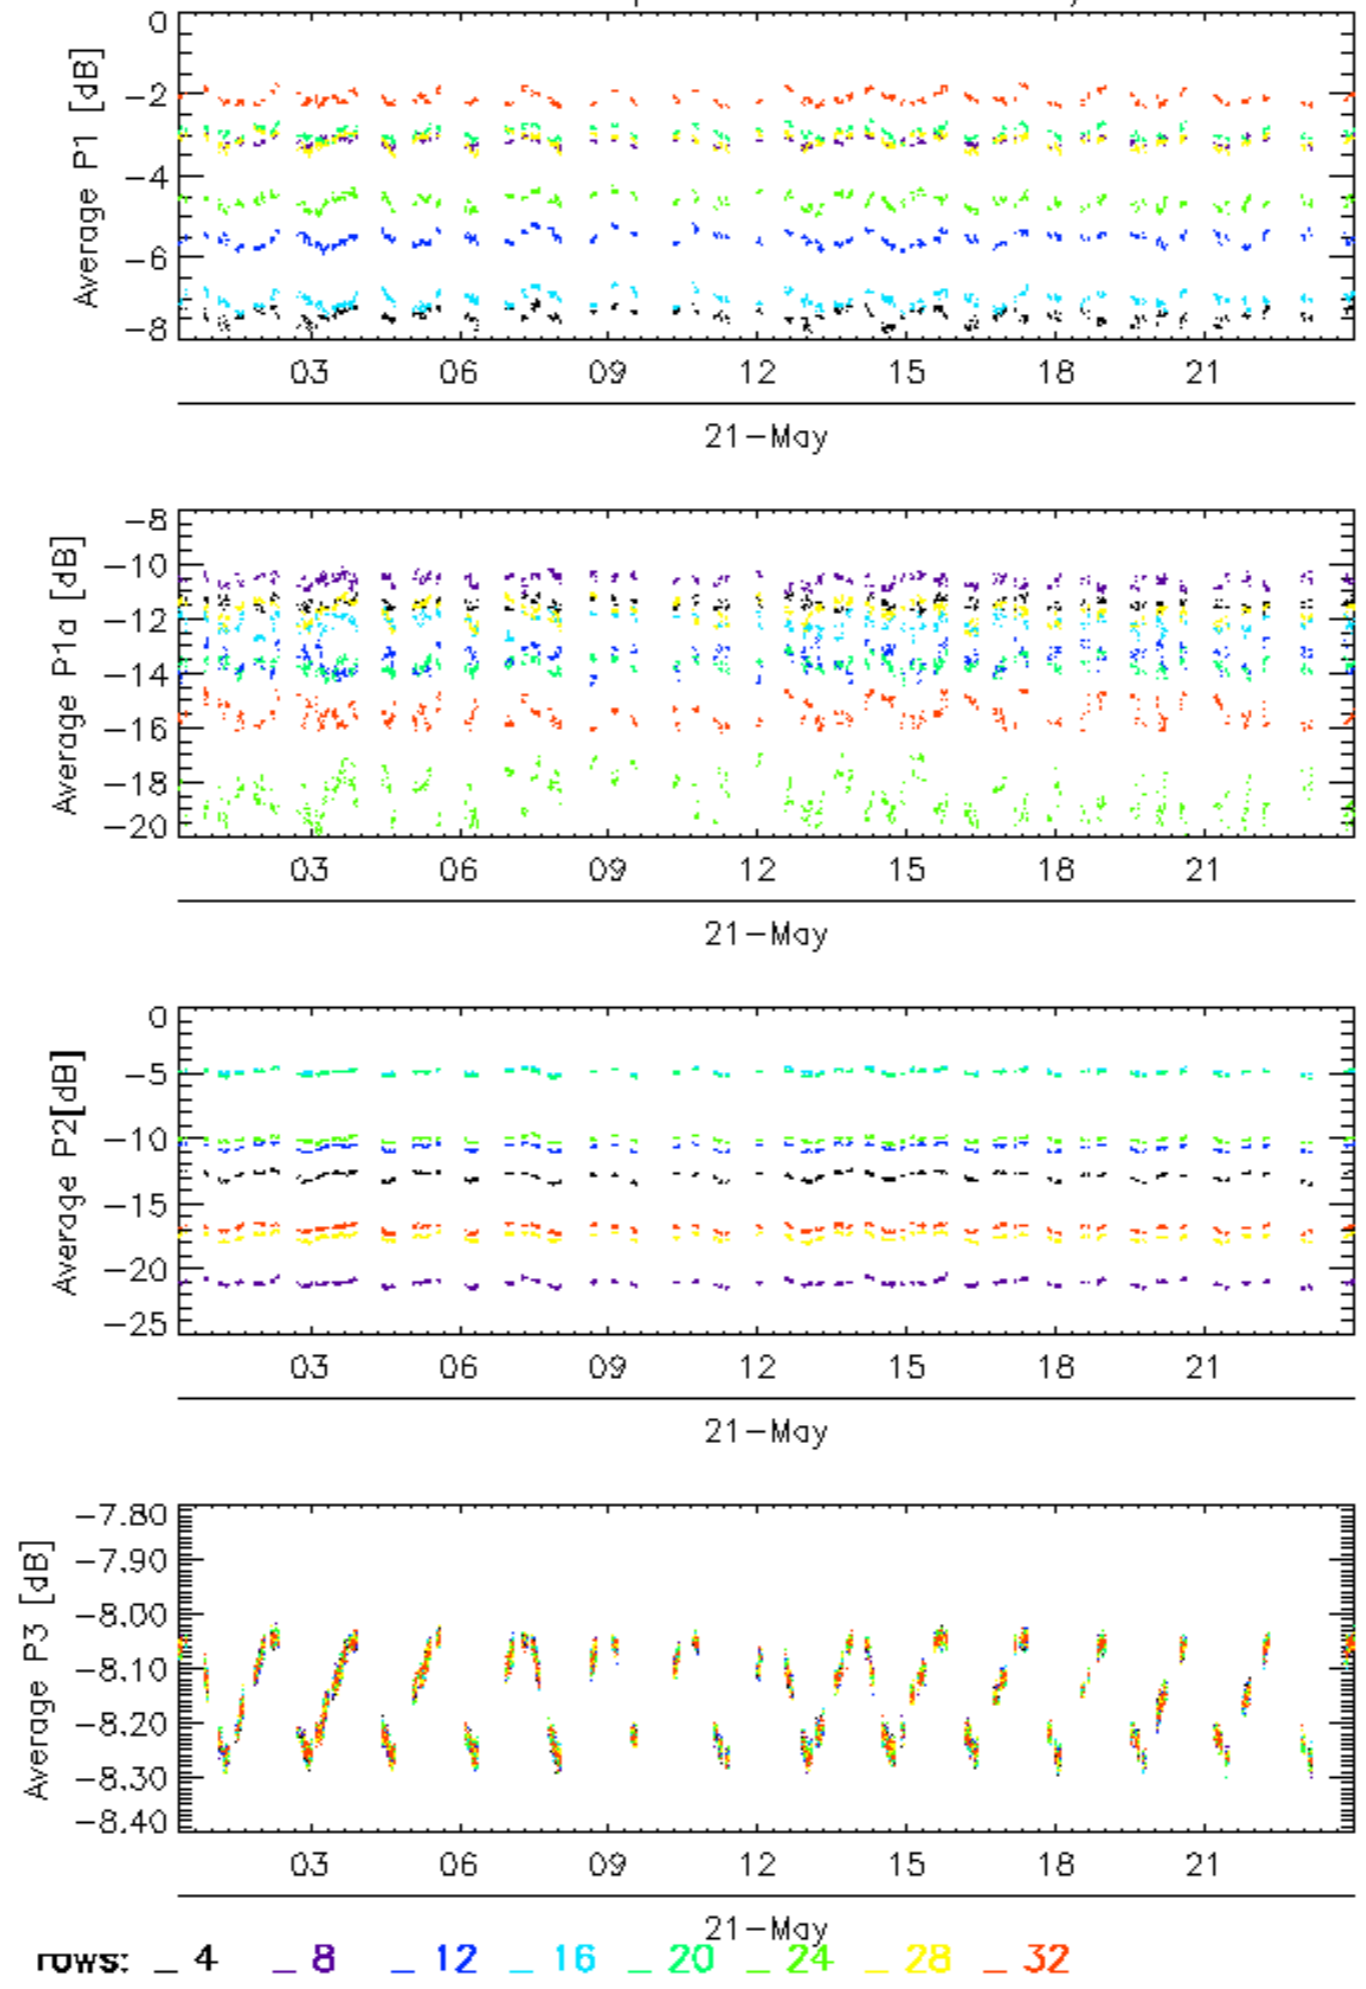


Calibration pulses for WVS IS2 V/V

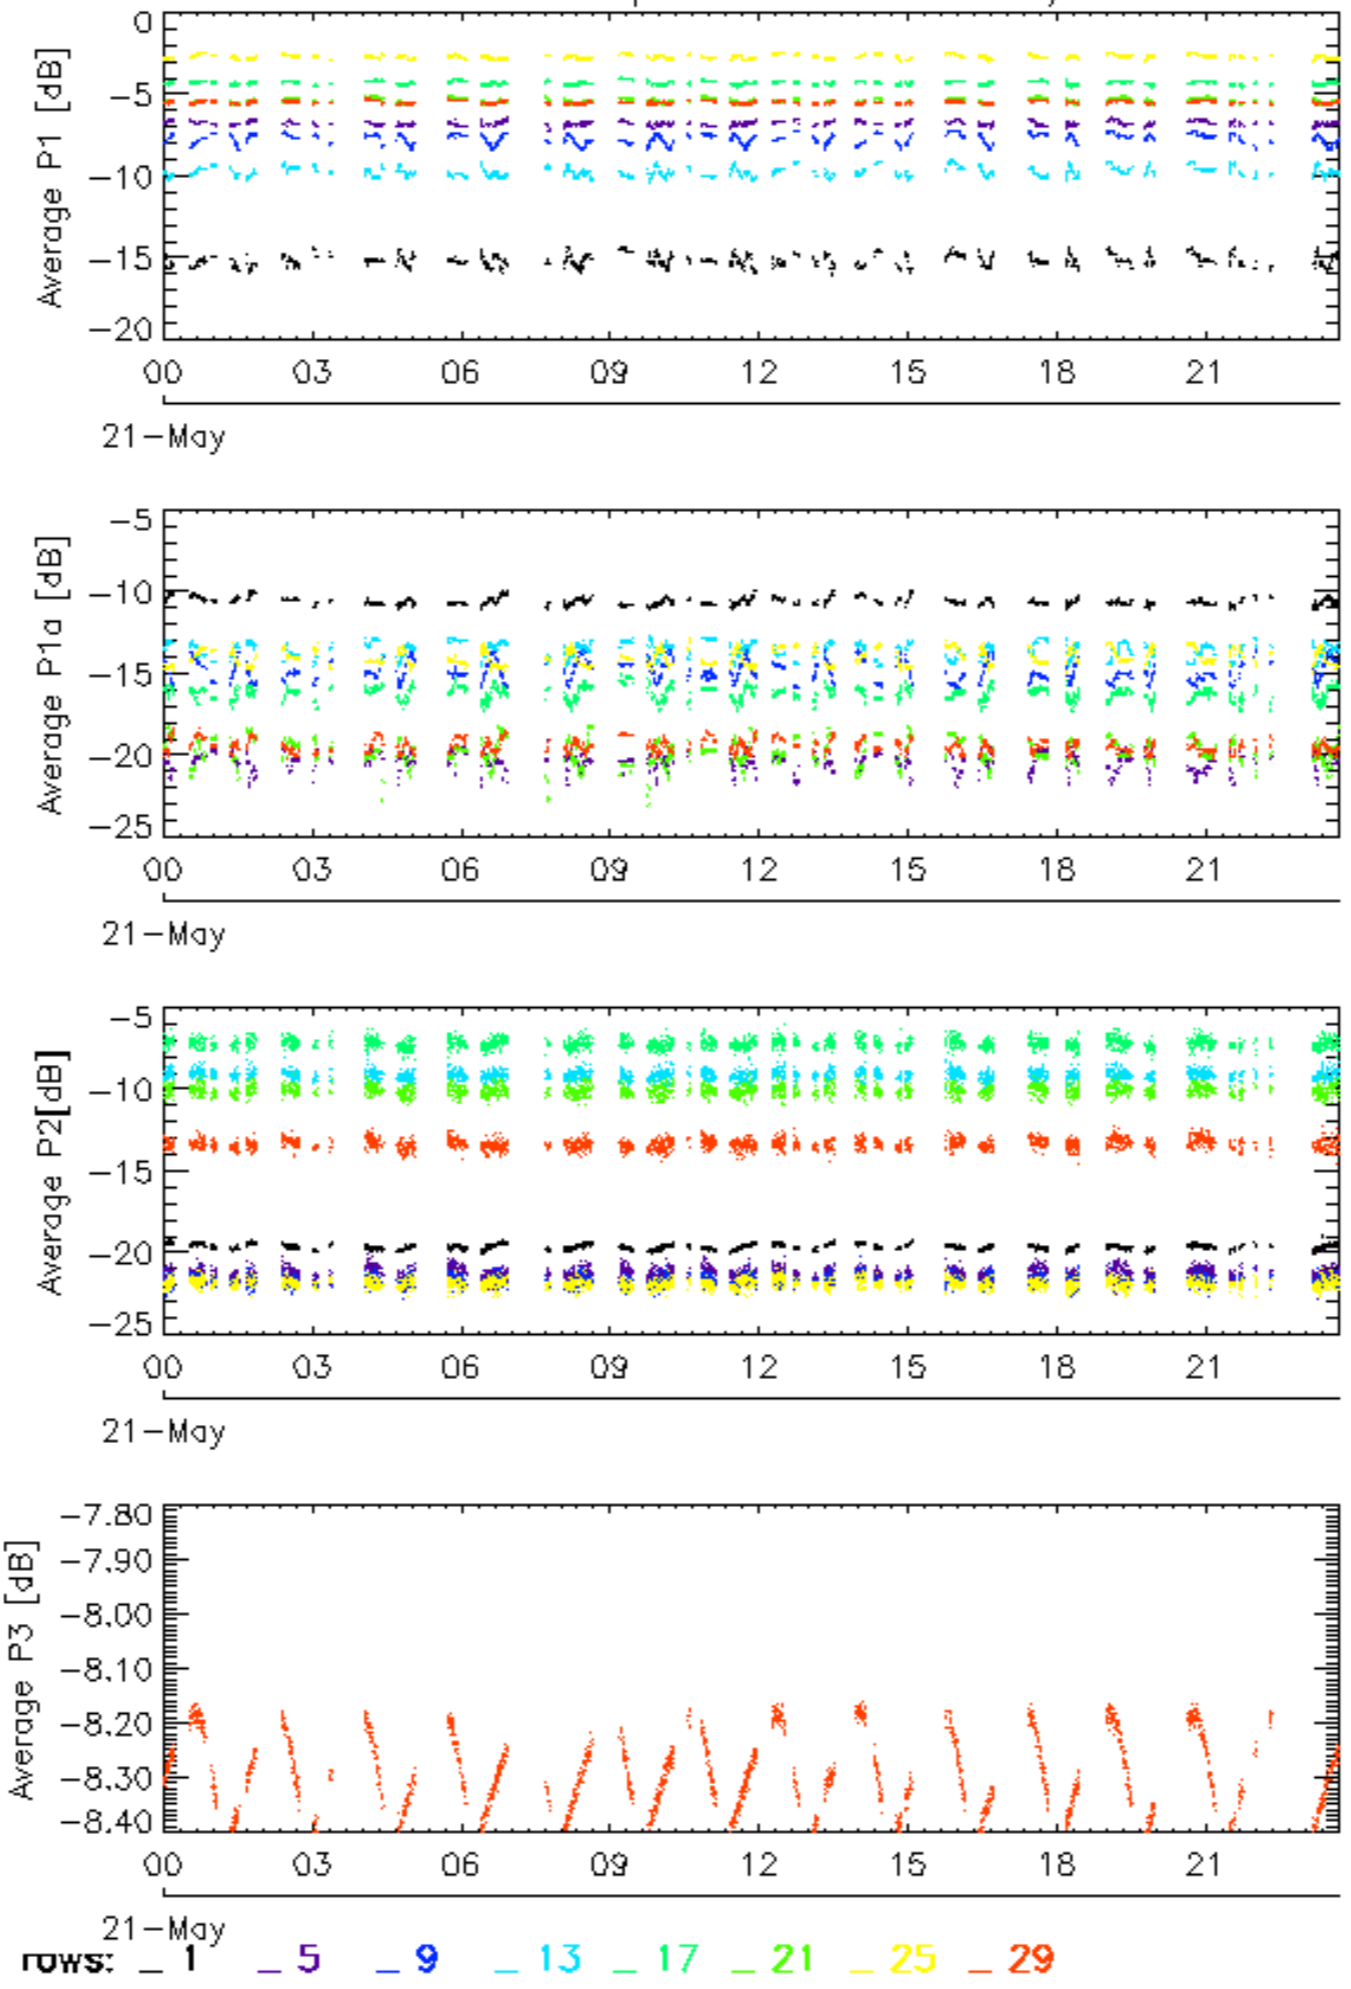


Calibration pulses for WVS IS2 V/V

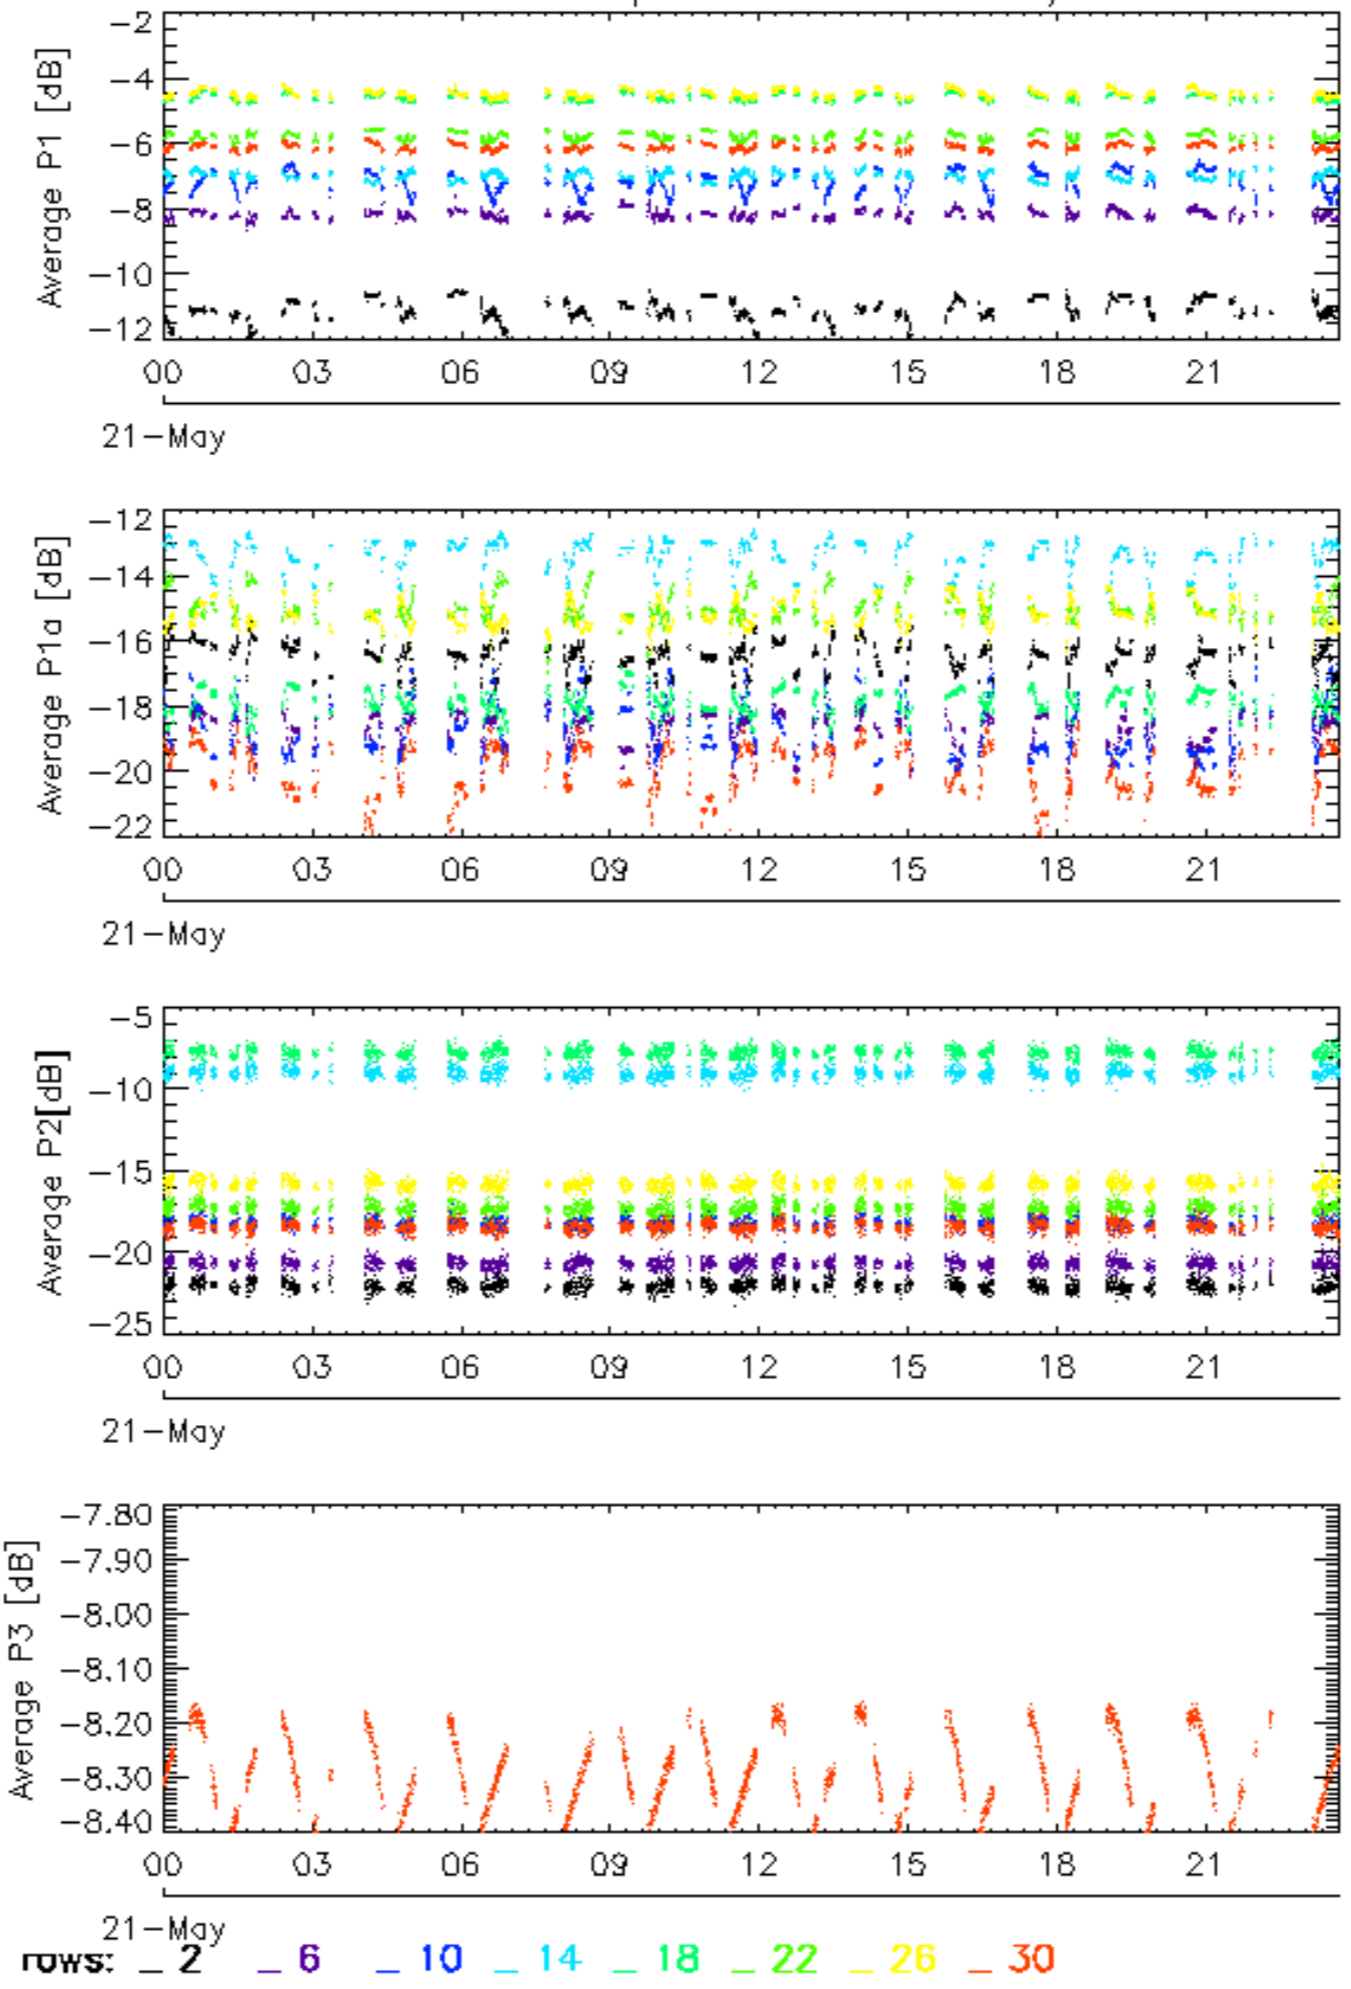



Calibration pulses for WVS IS2 V/V


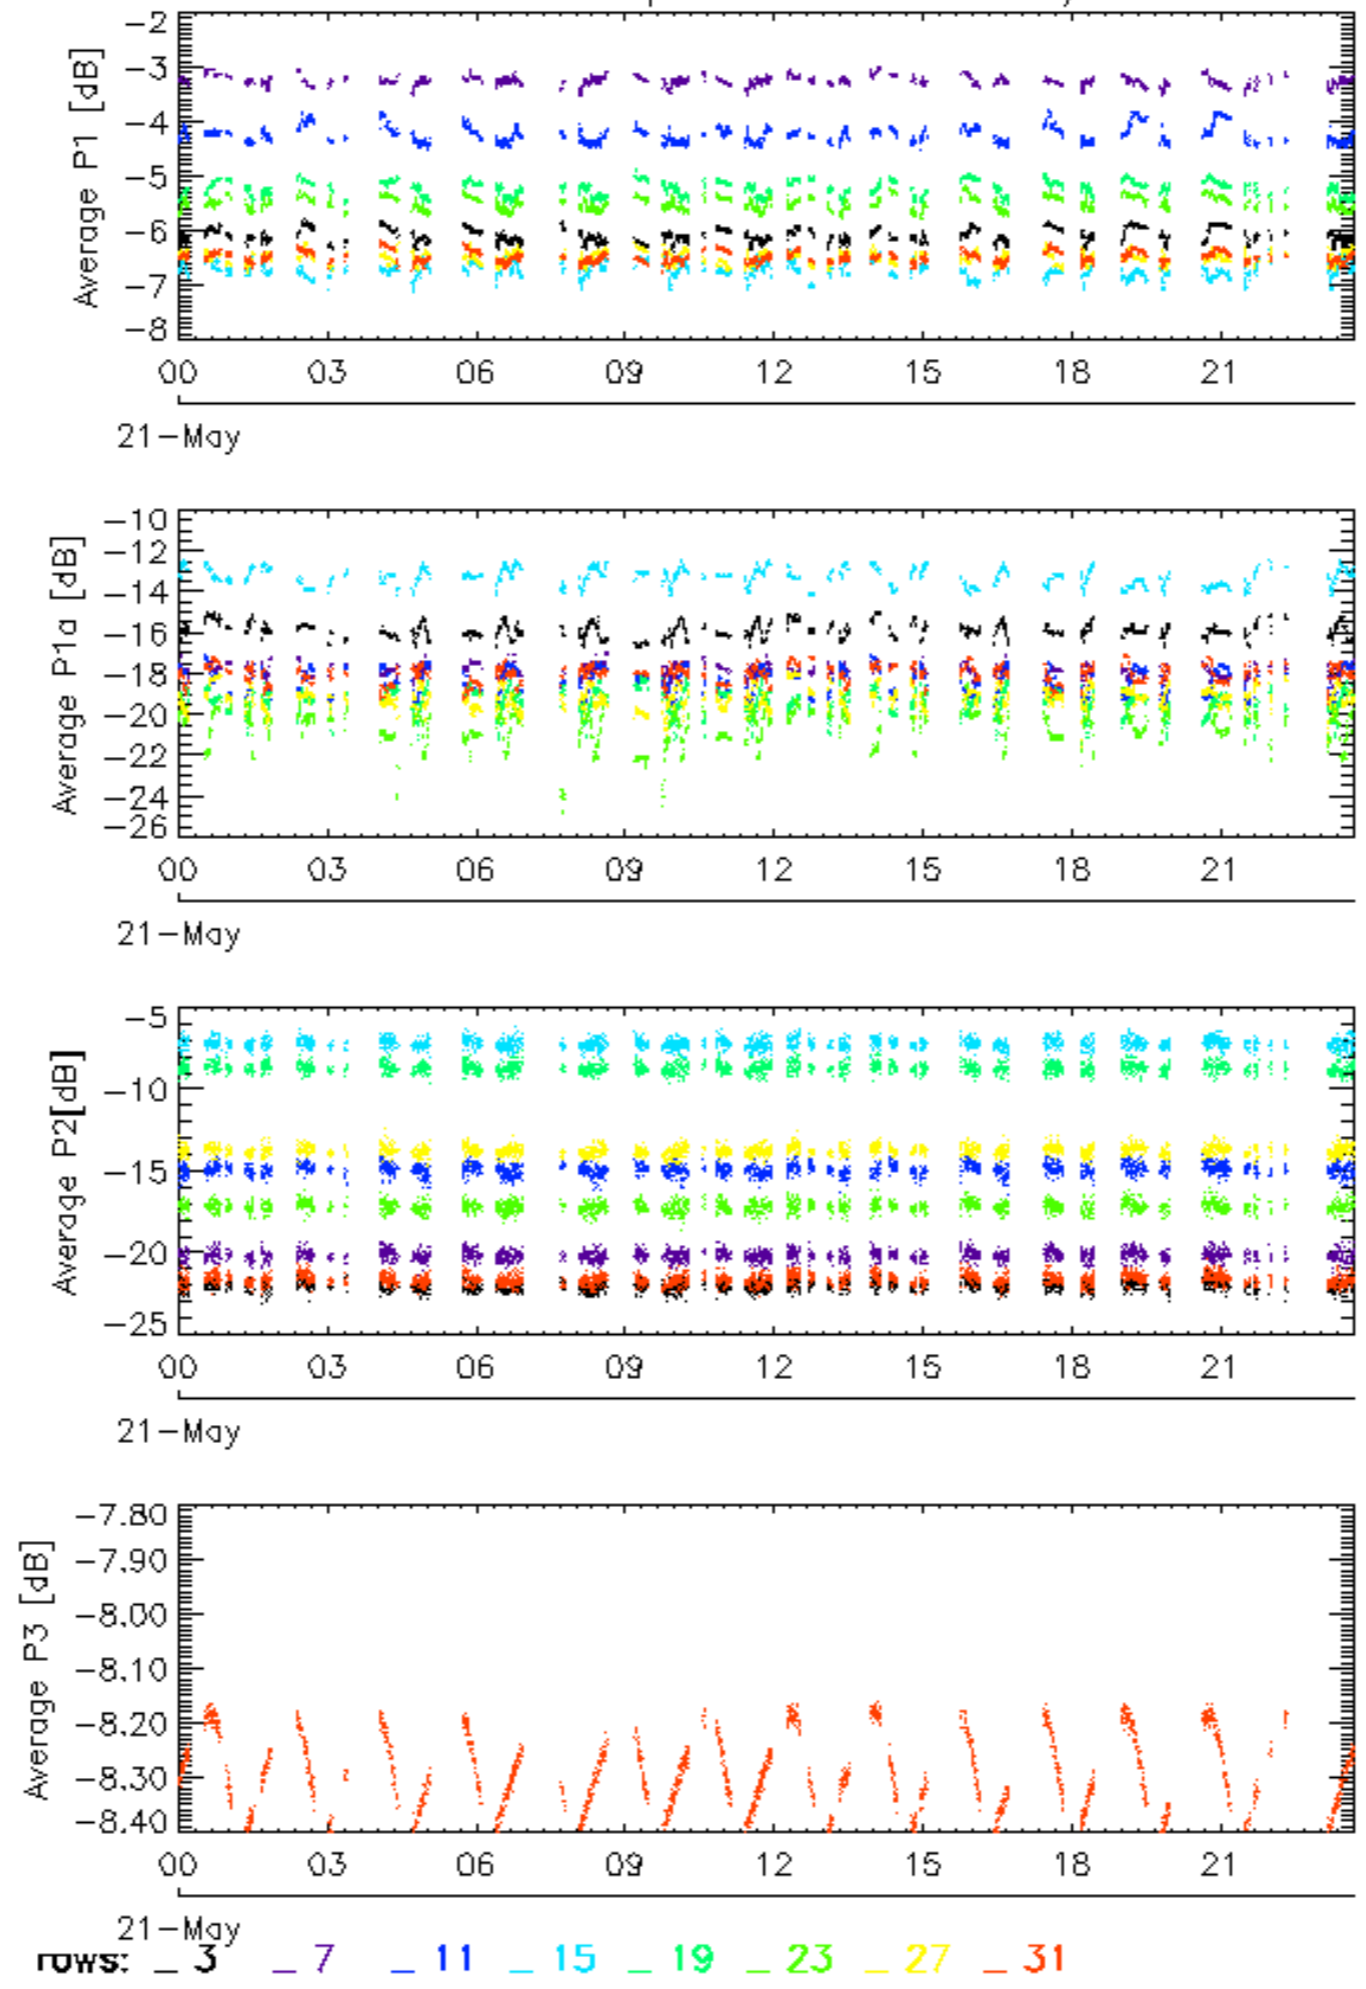




Calibration pulses for WVS IS2 V/V


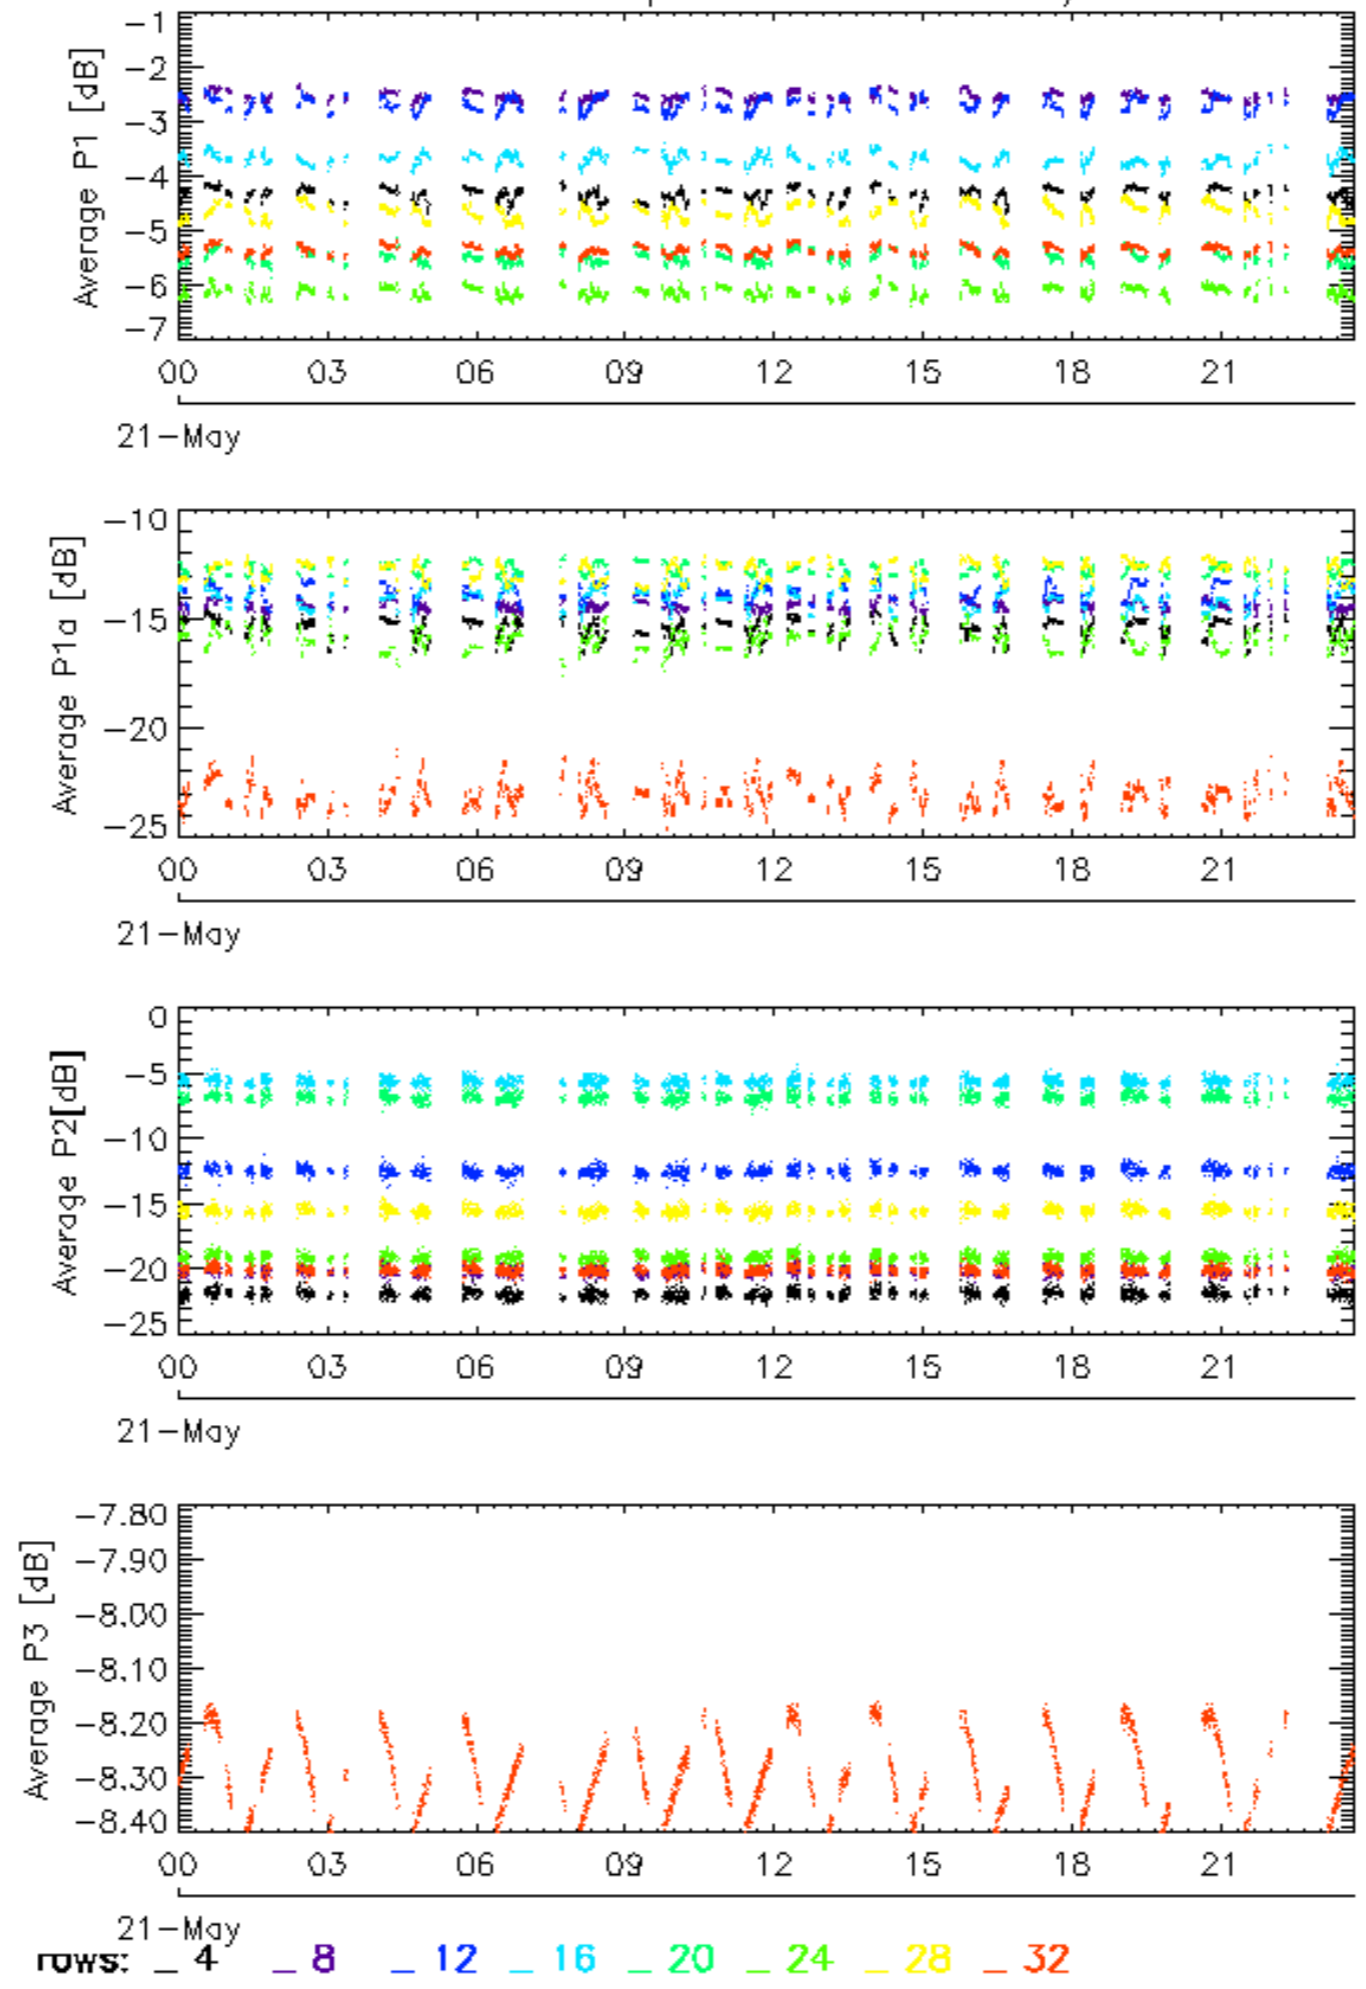



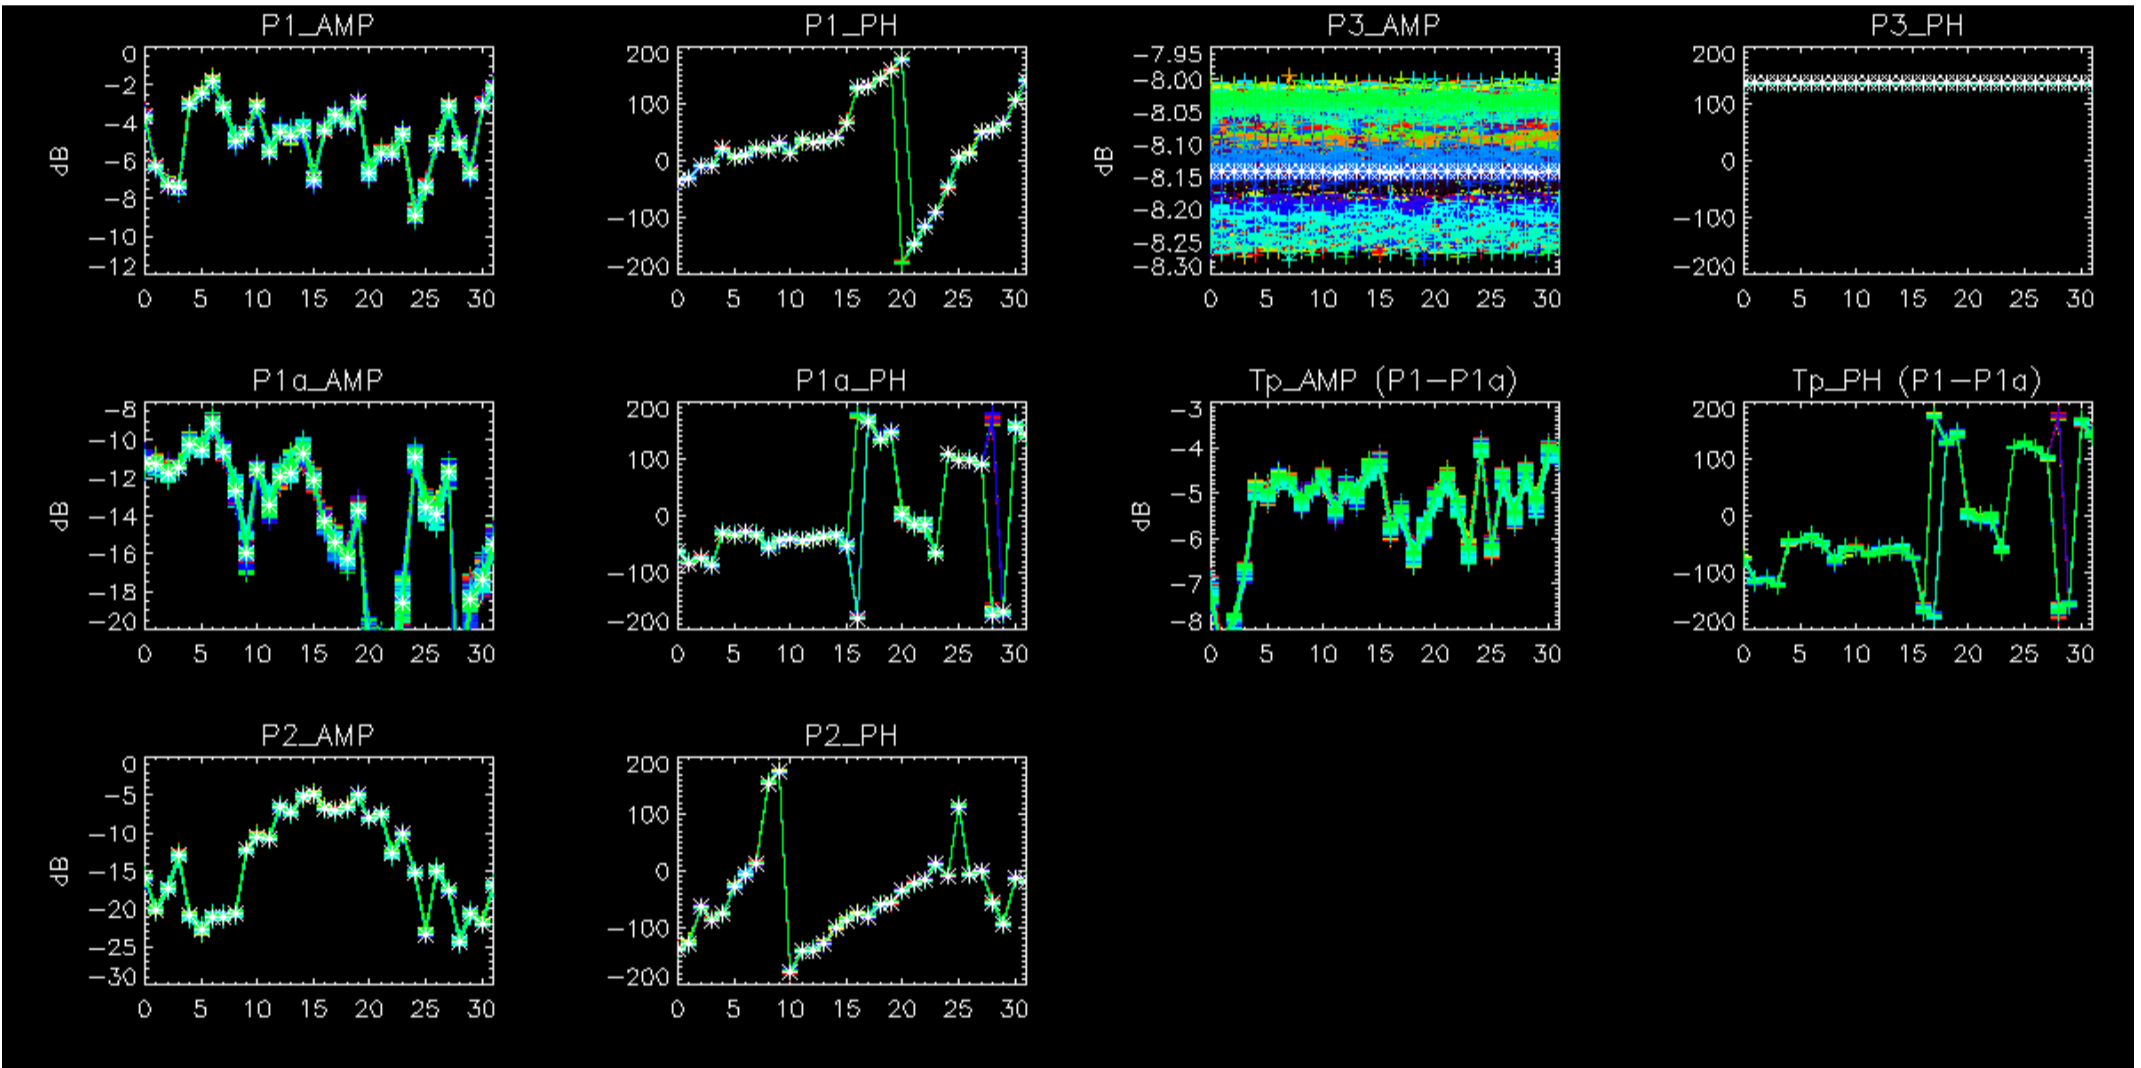



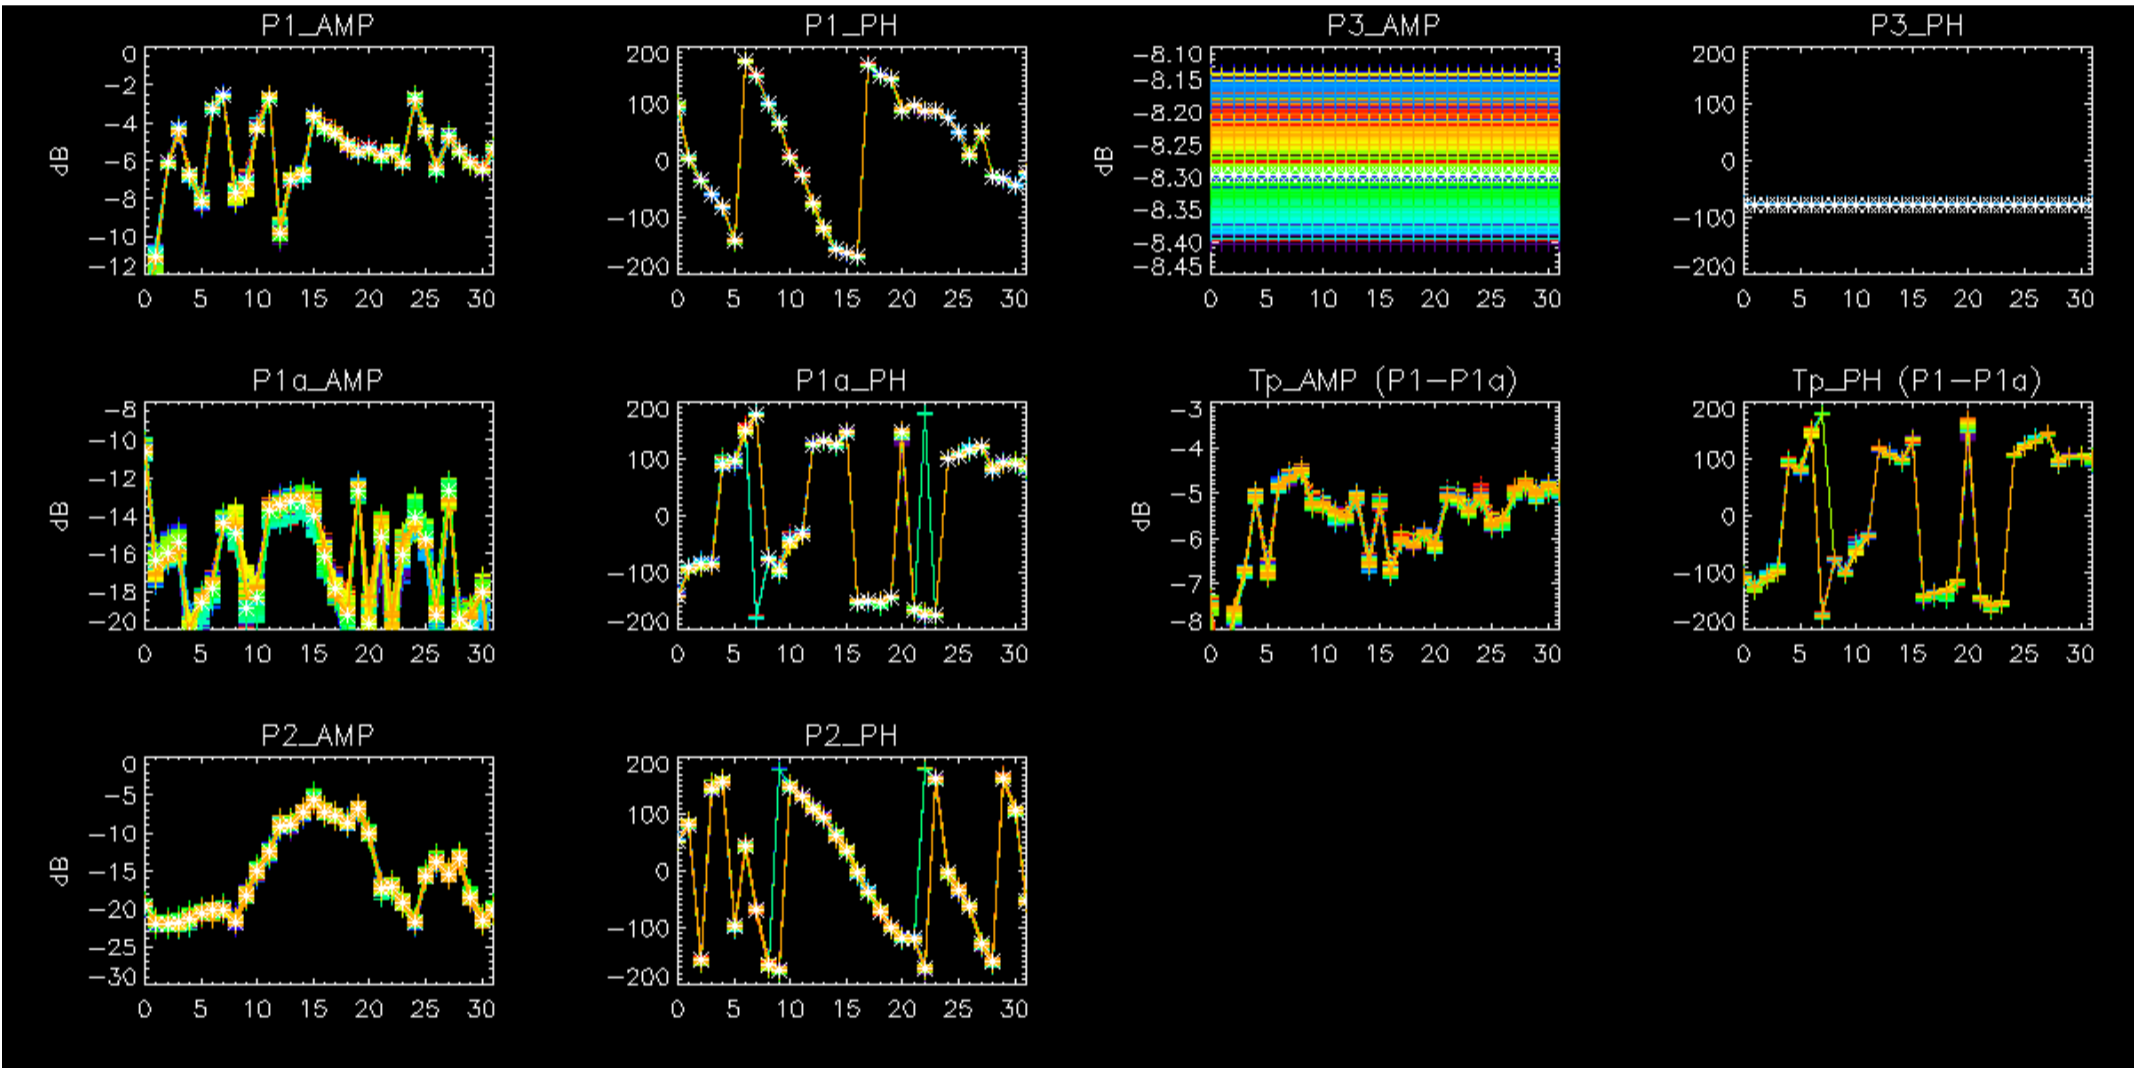


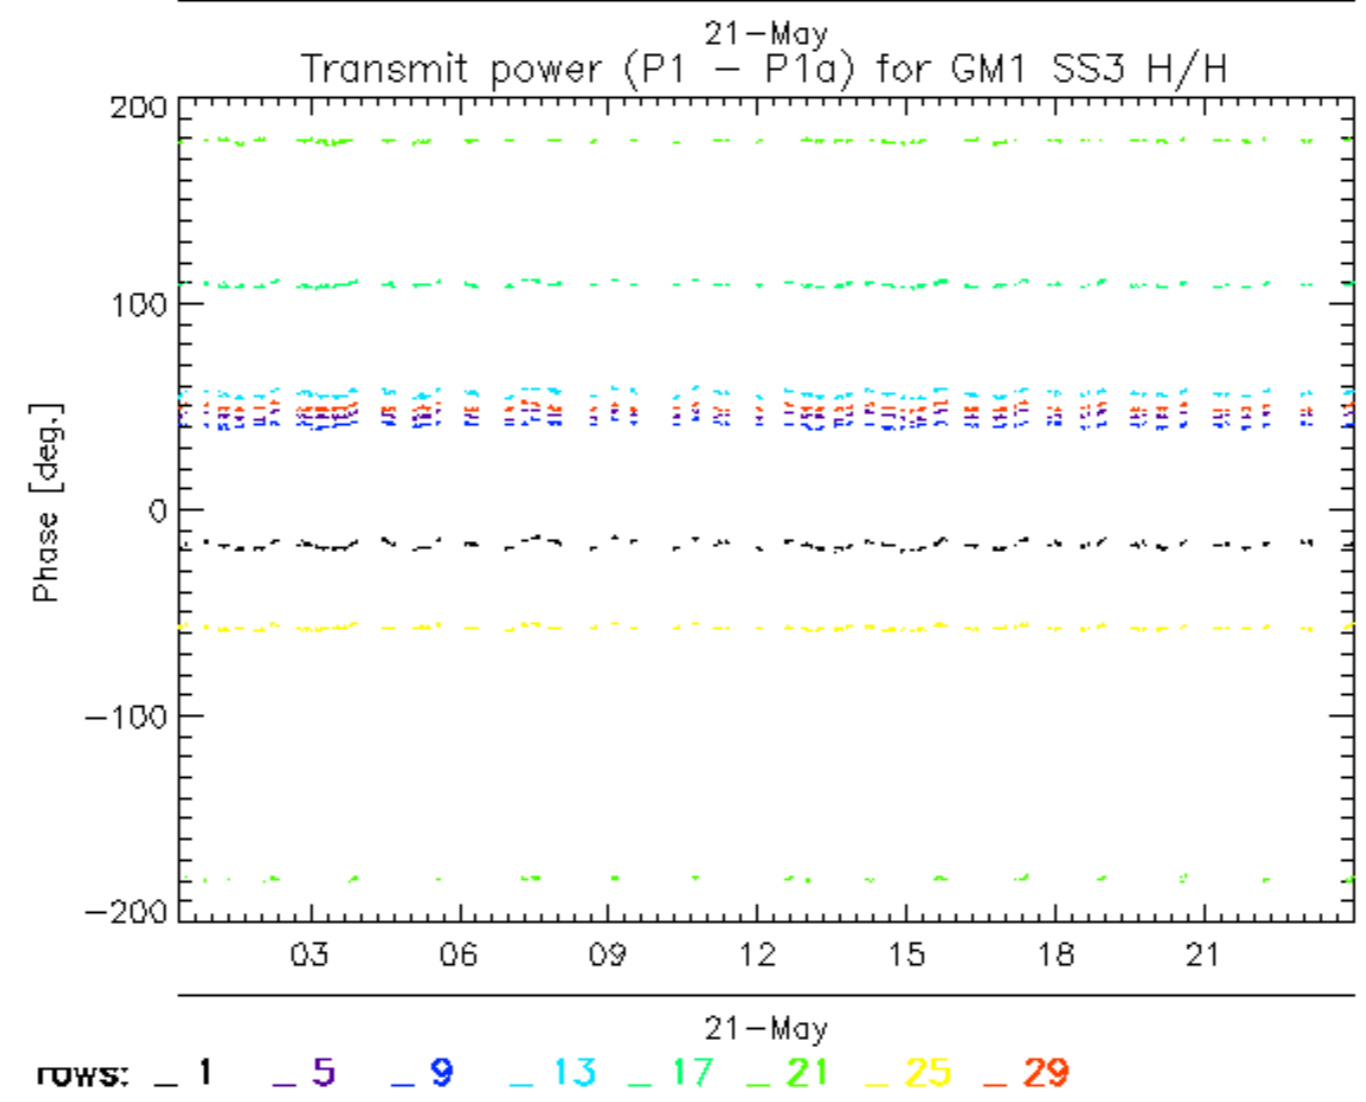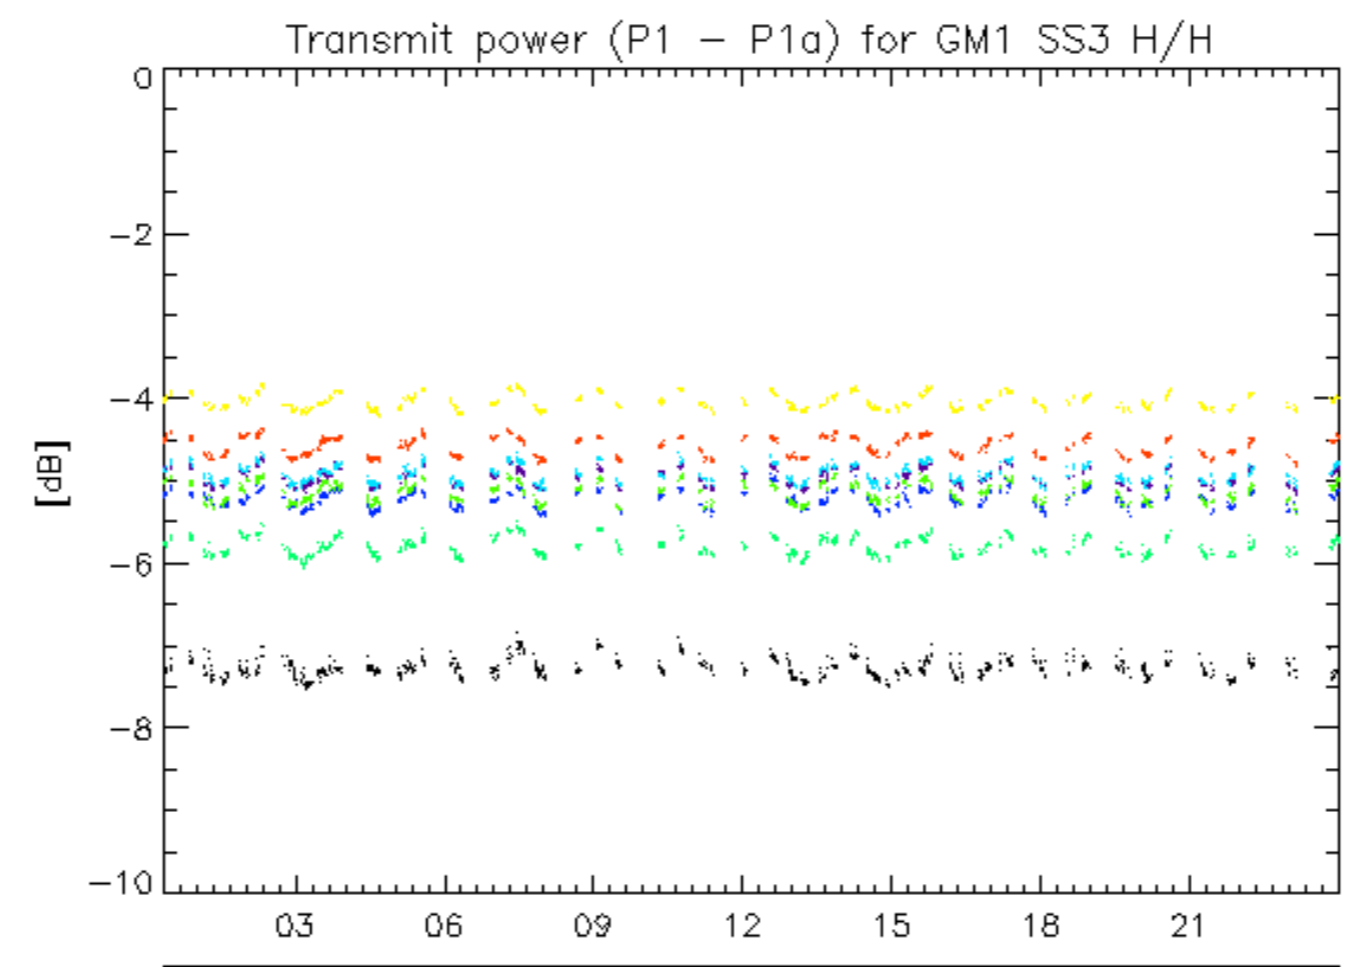

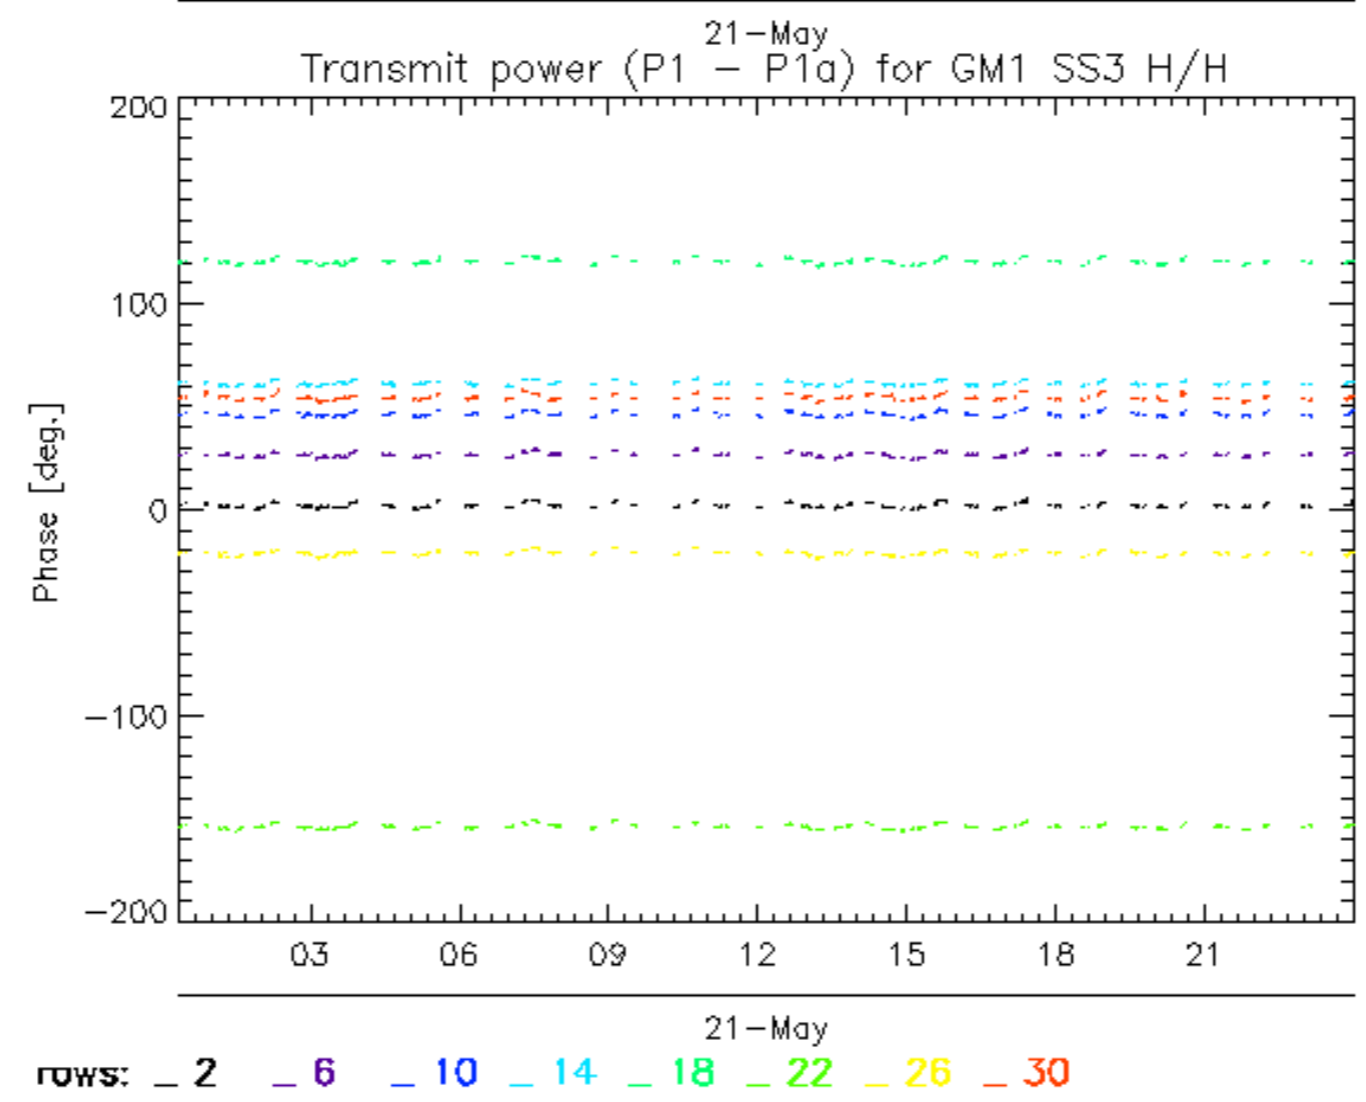
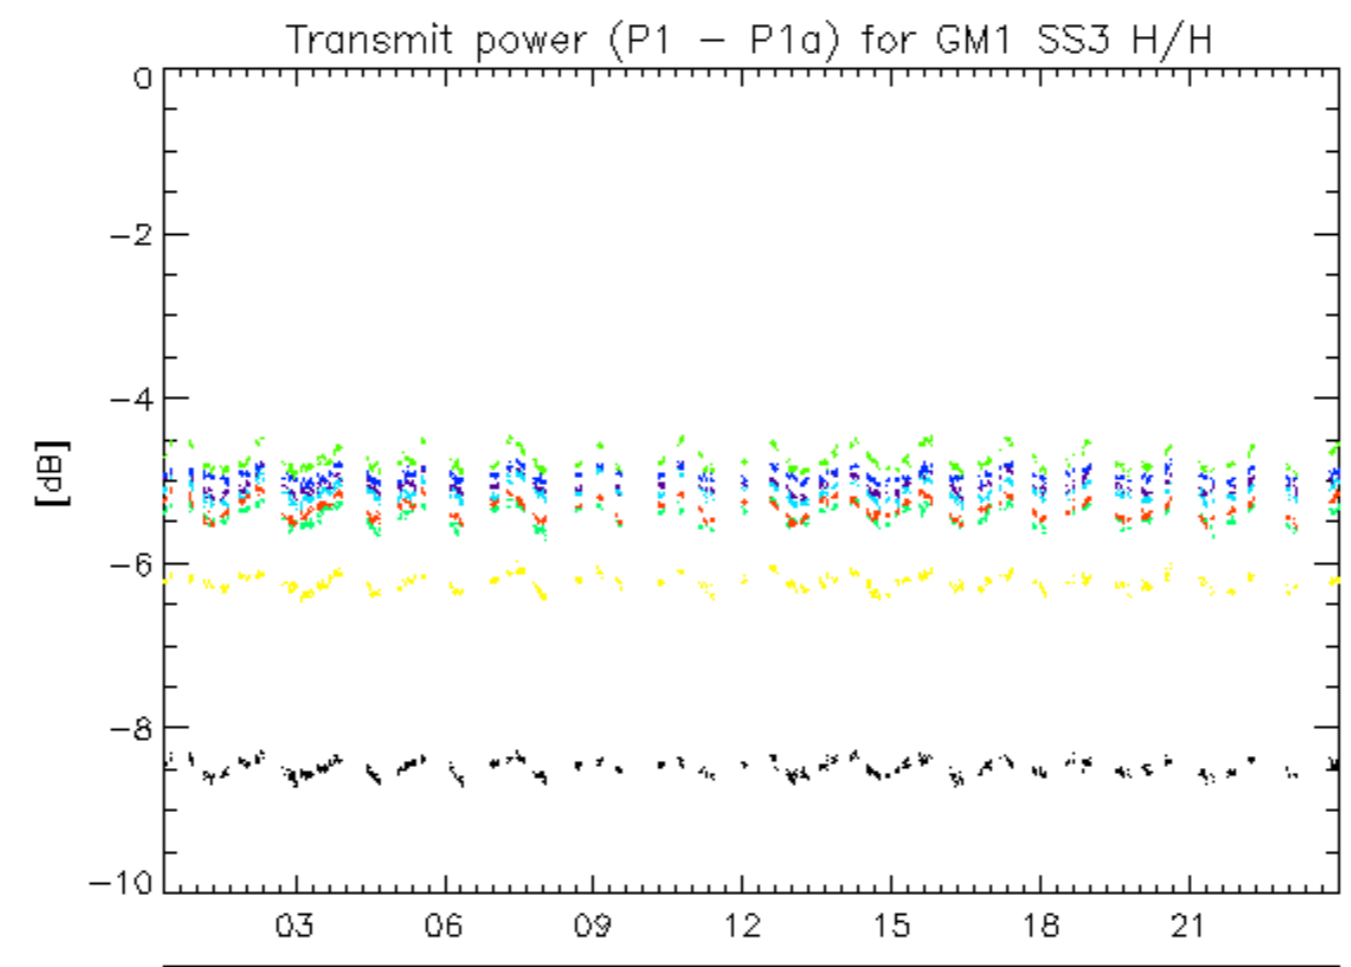


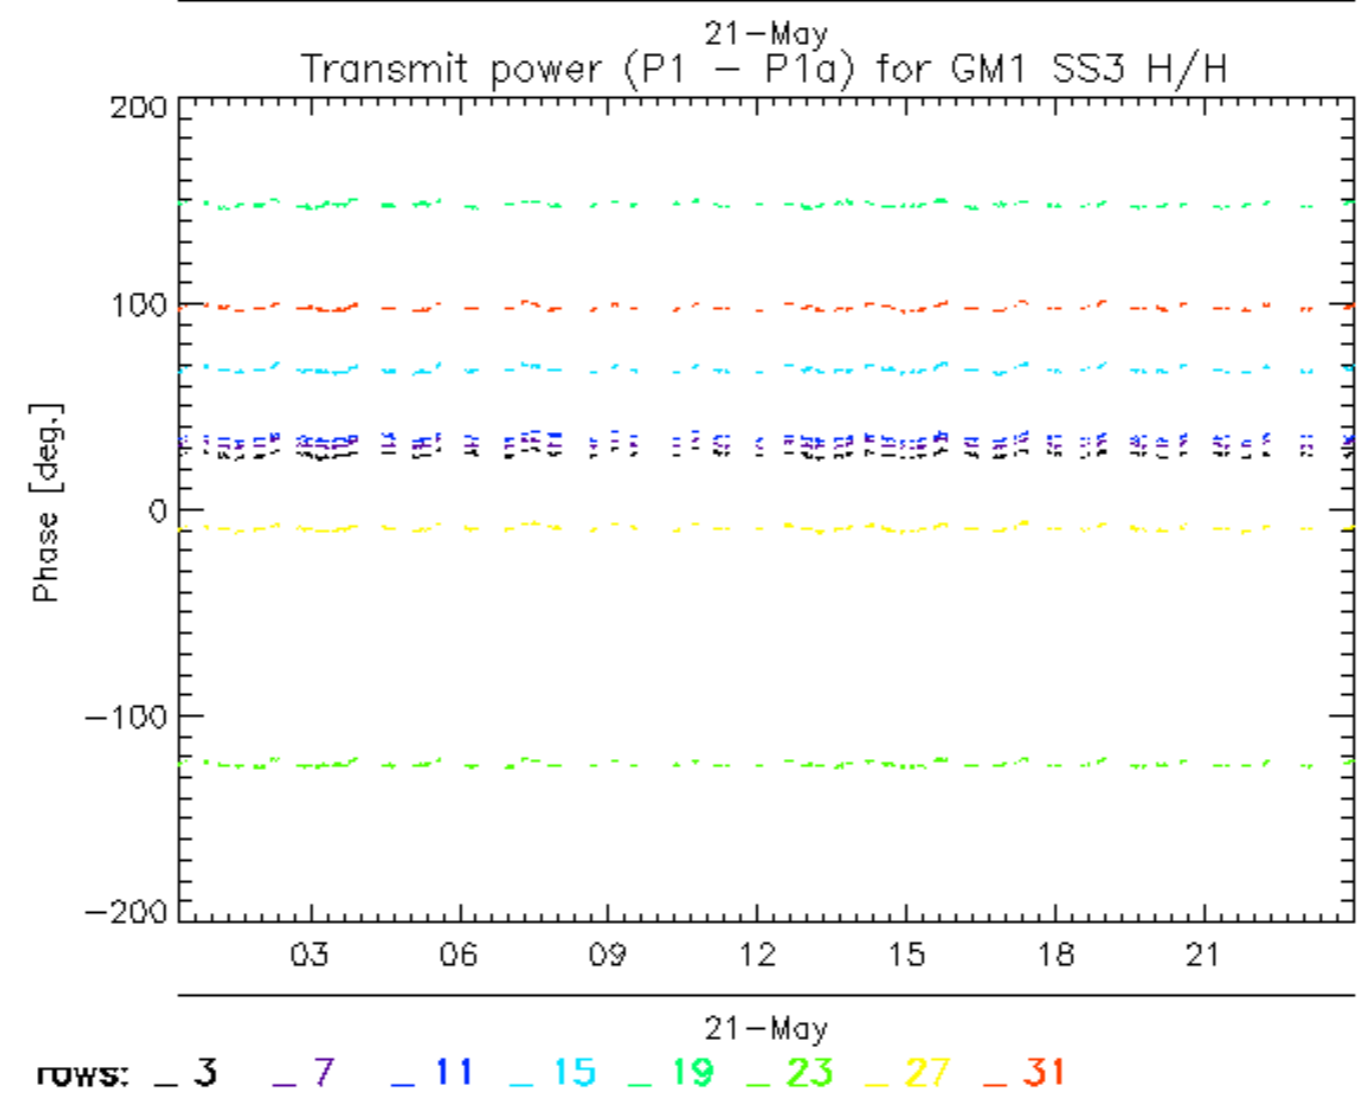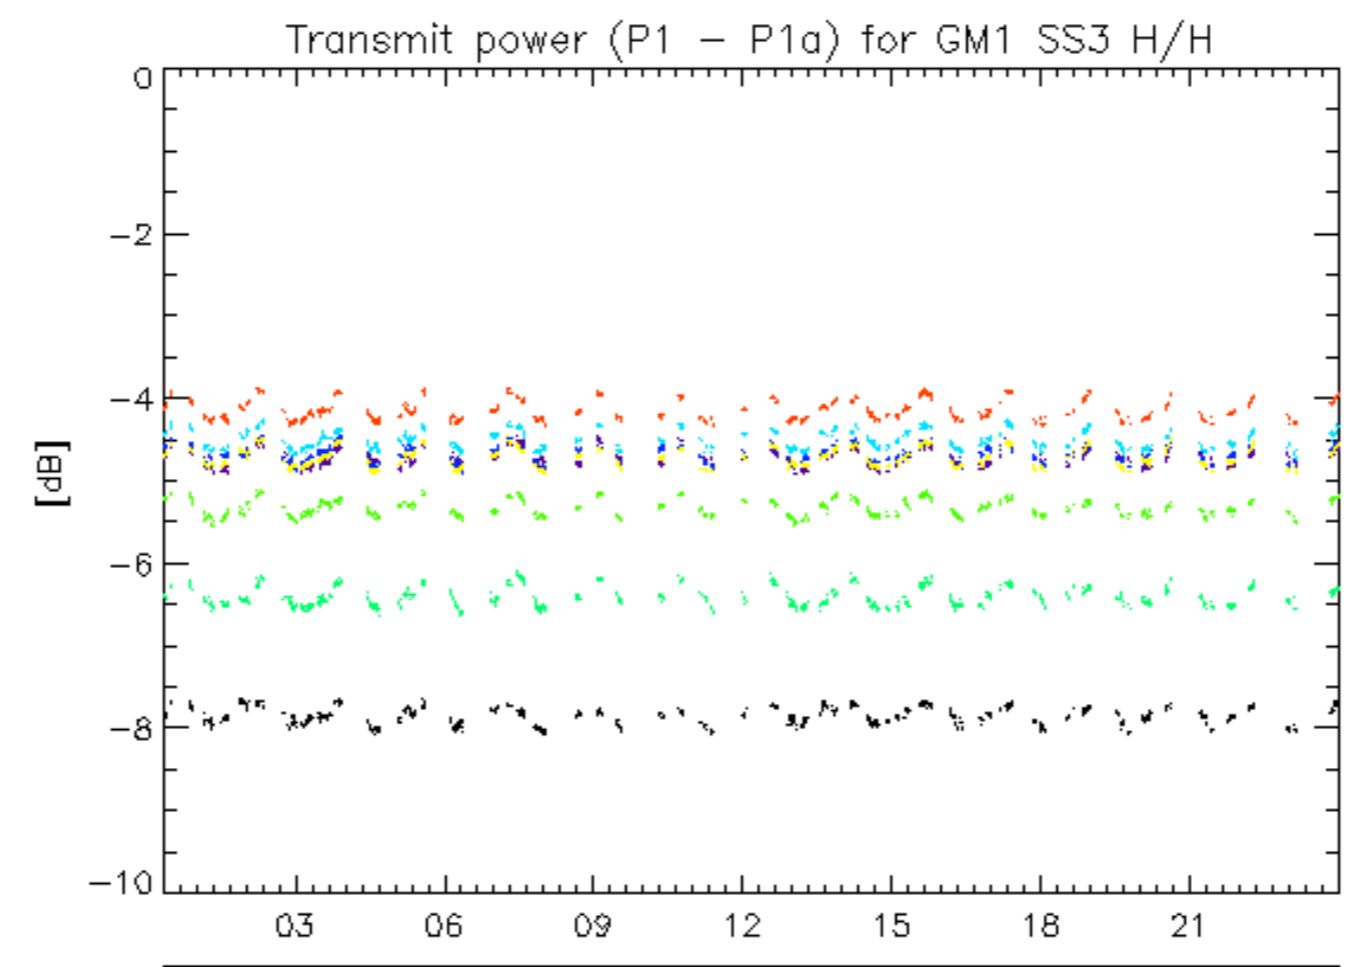

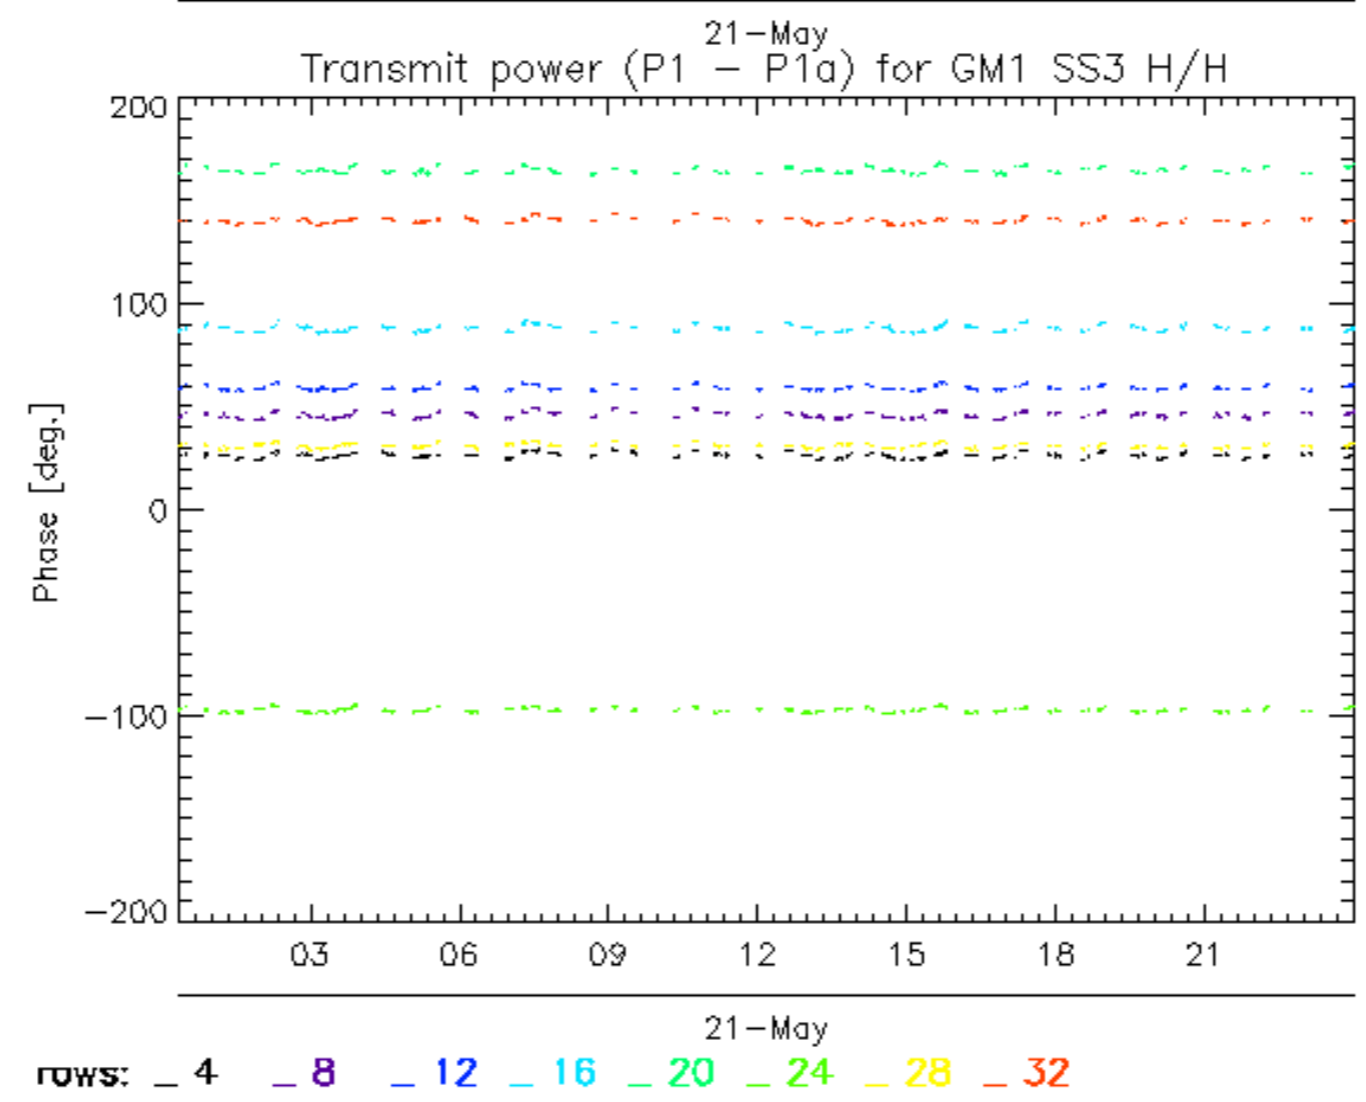
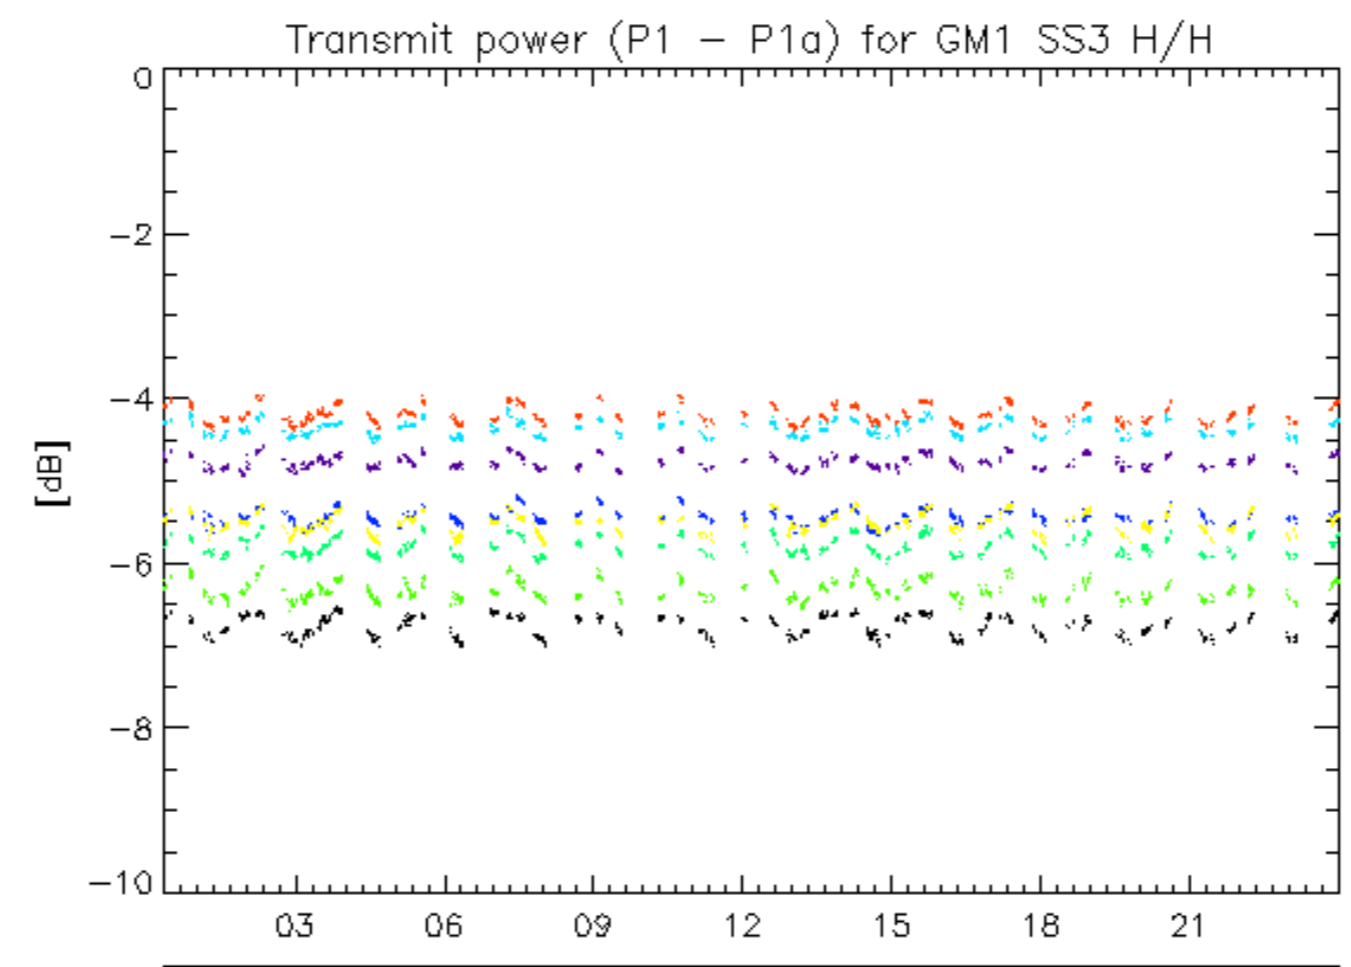


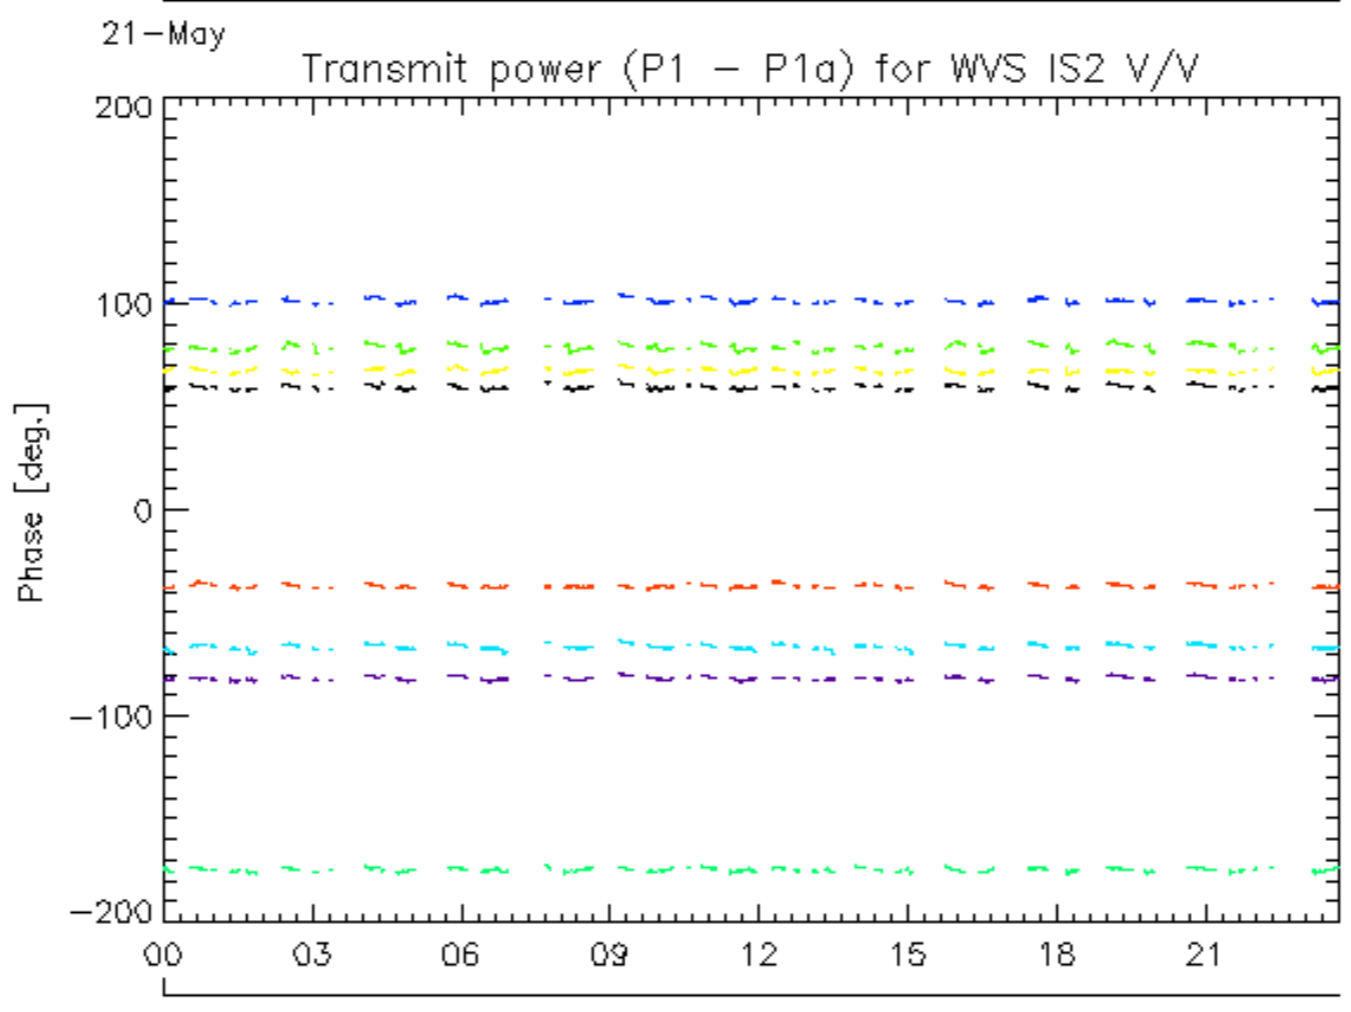
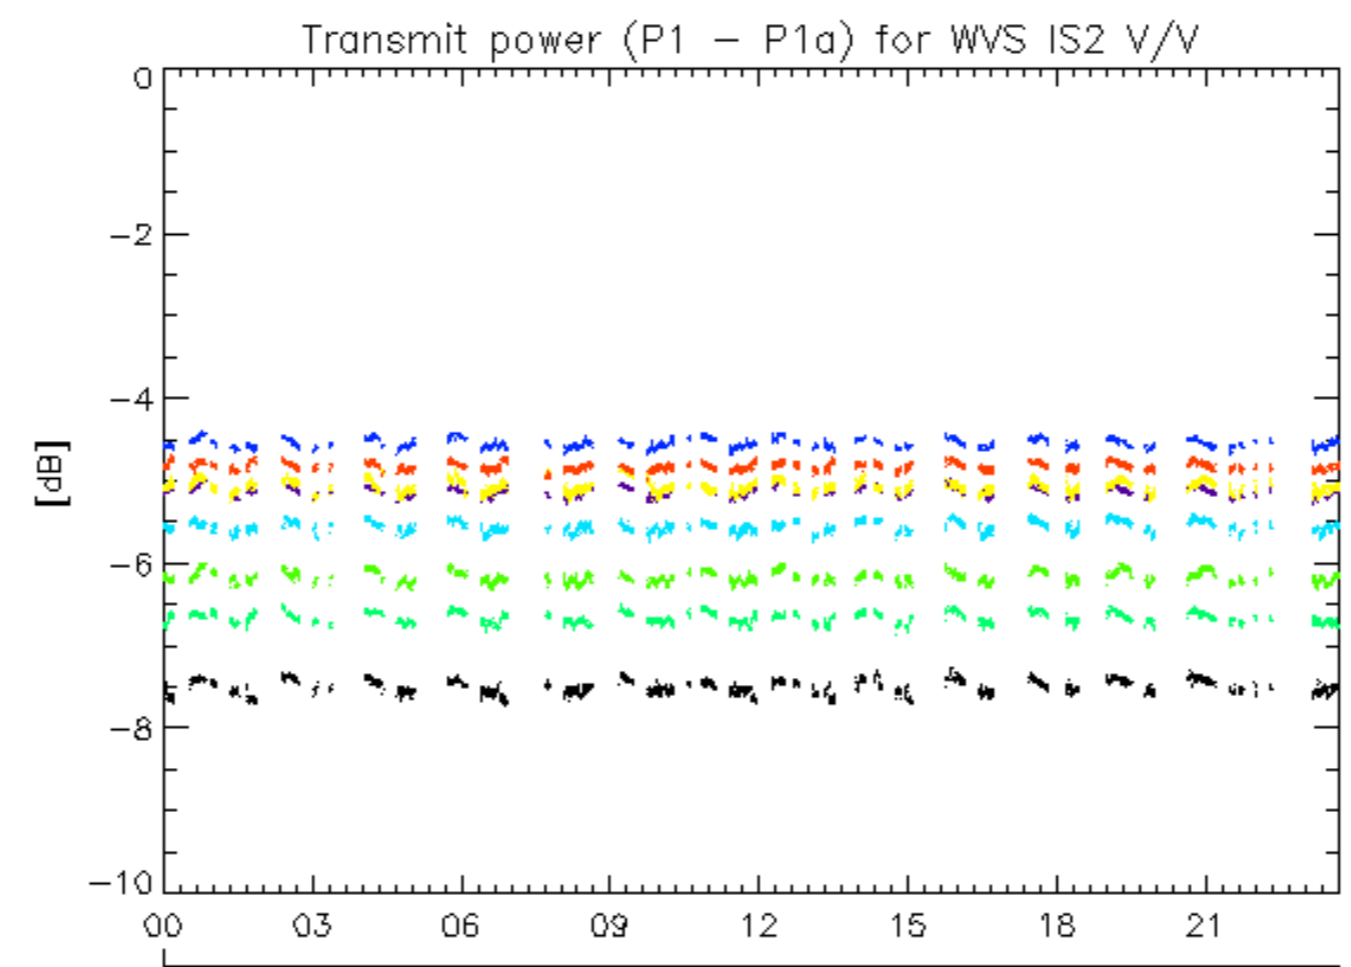



rows: - 1 - 5 - 9 - 13 - 17 - 21 - 25 - 29

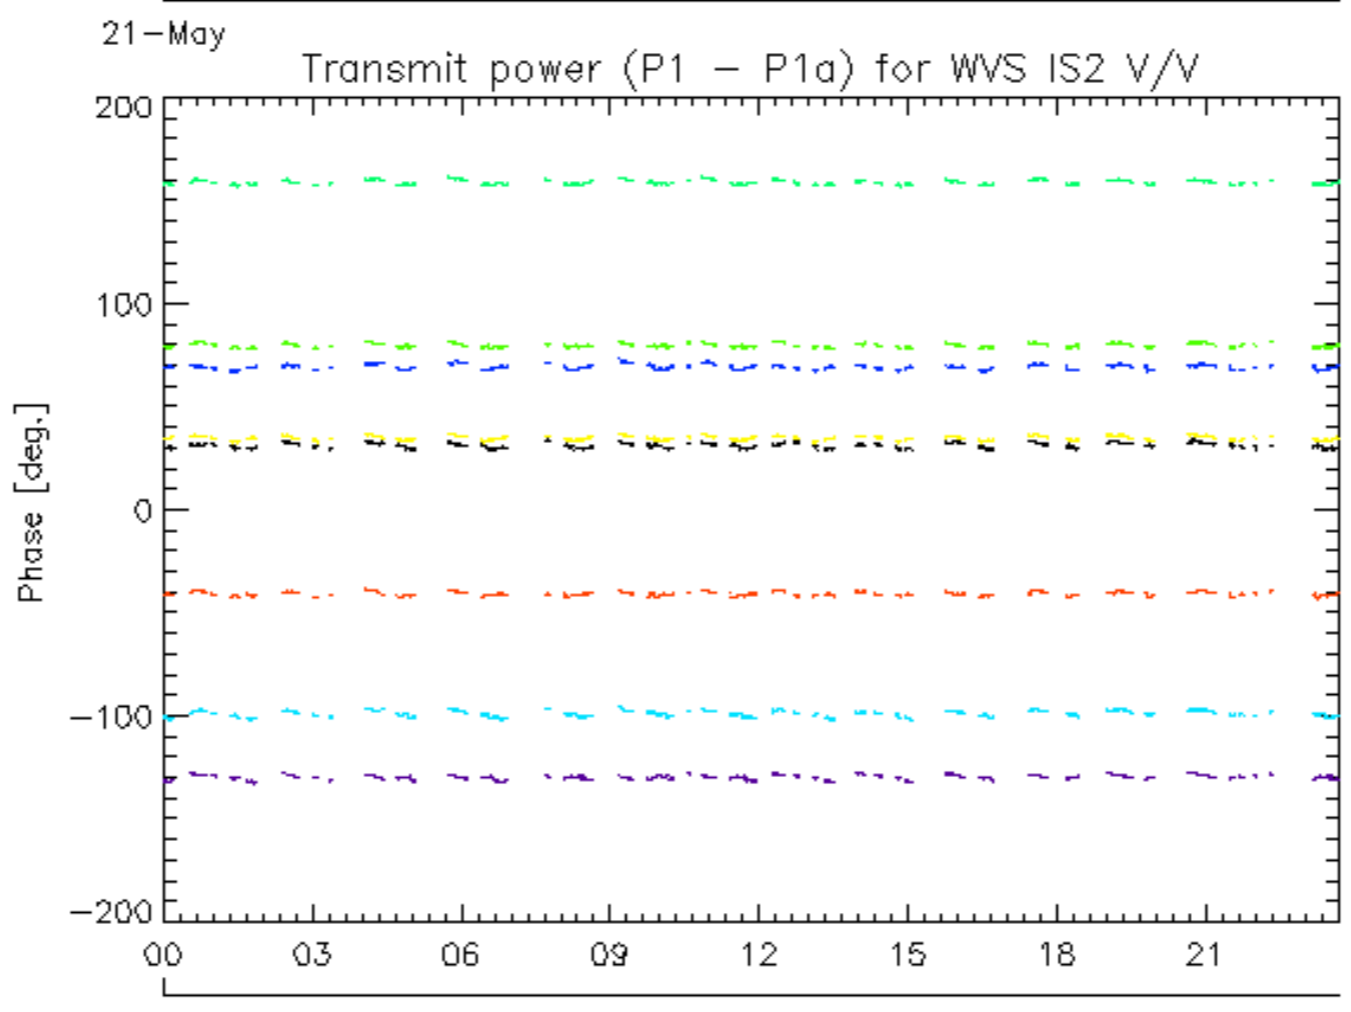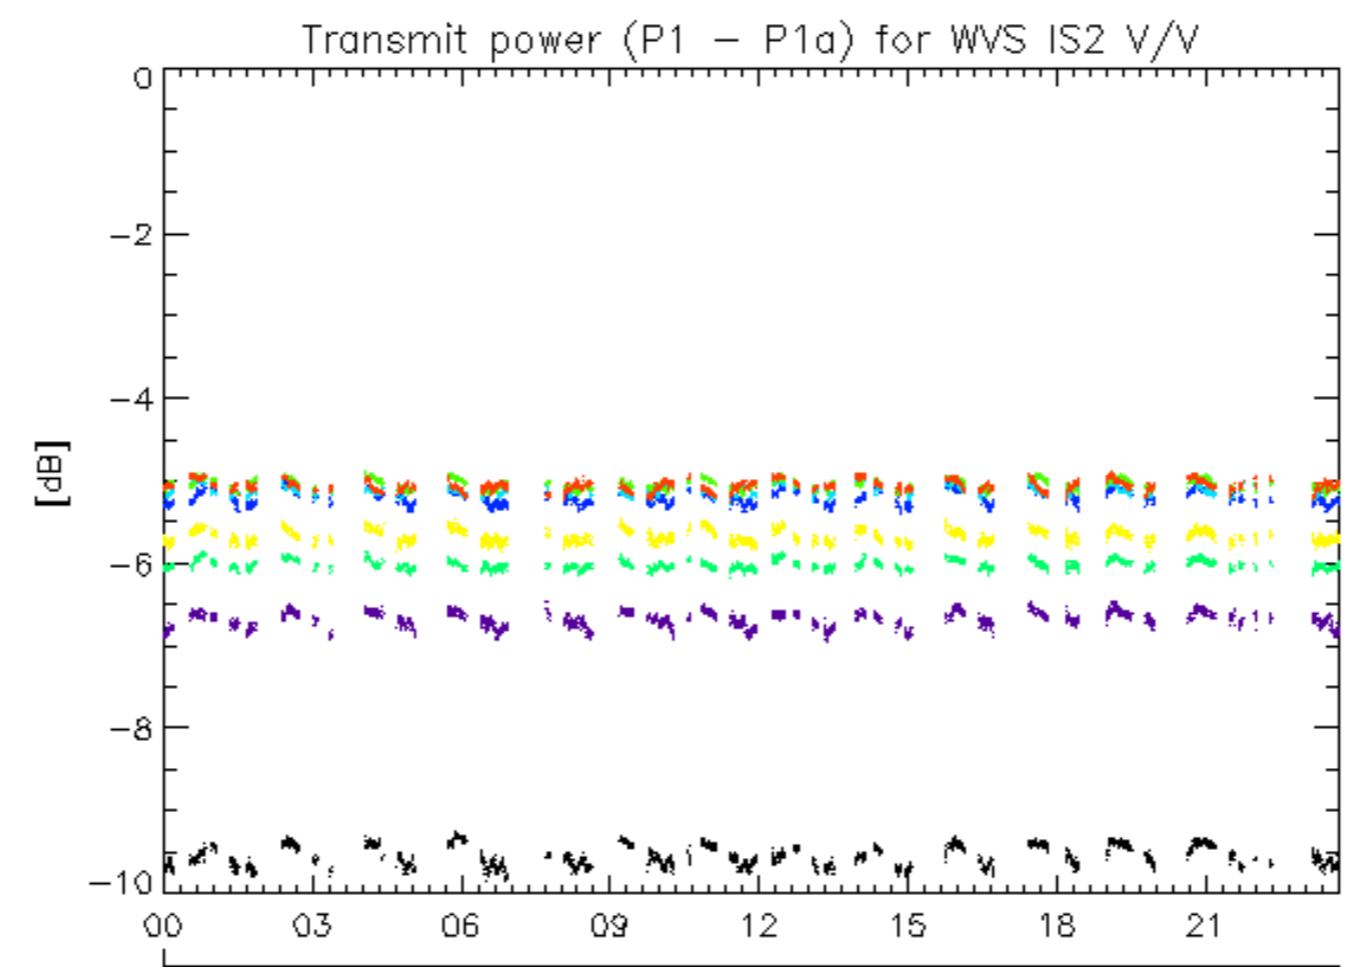



rows: - 2 - 6 - 10 - 14 - 18 - 22 - 26 - 30

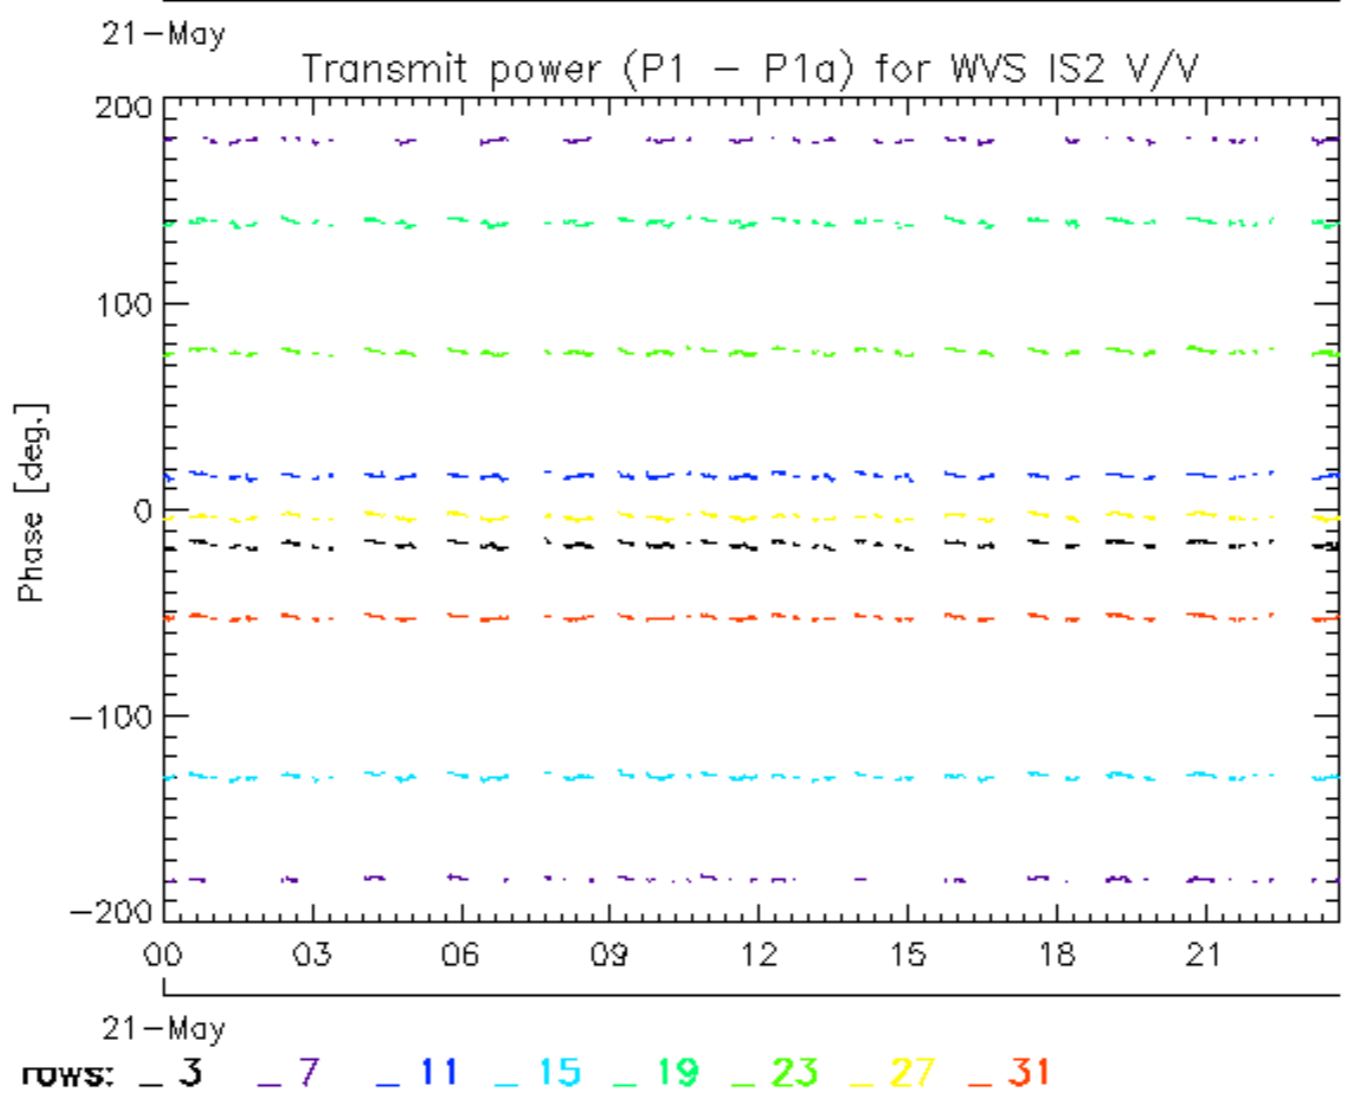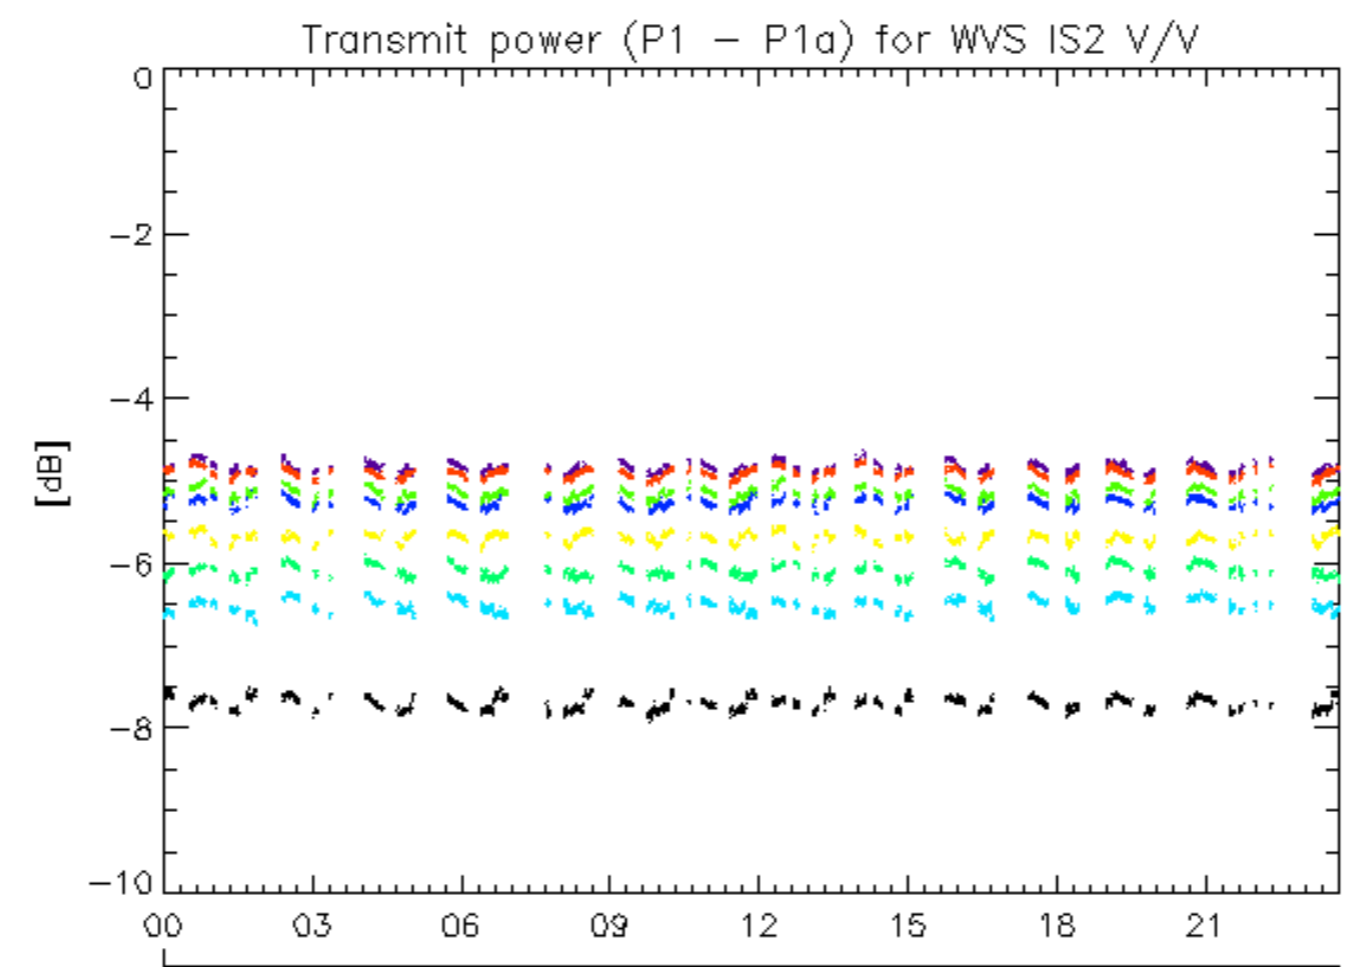


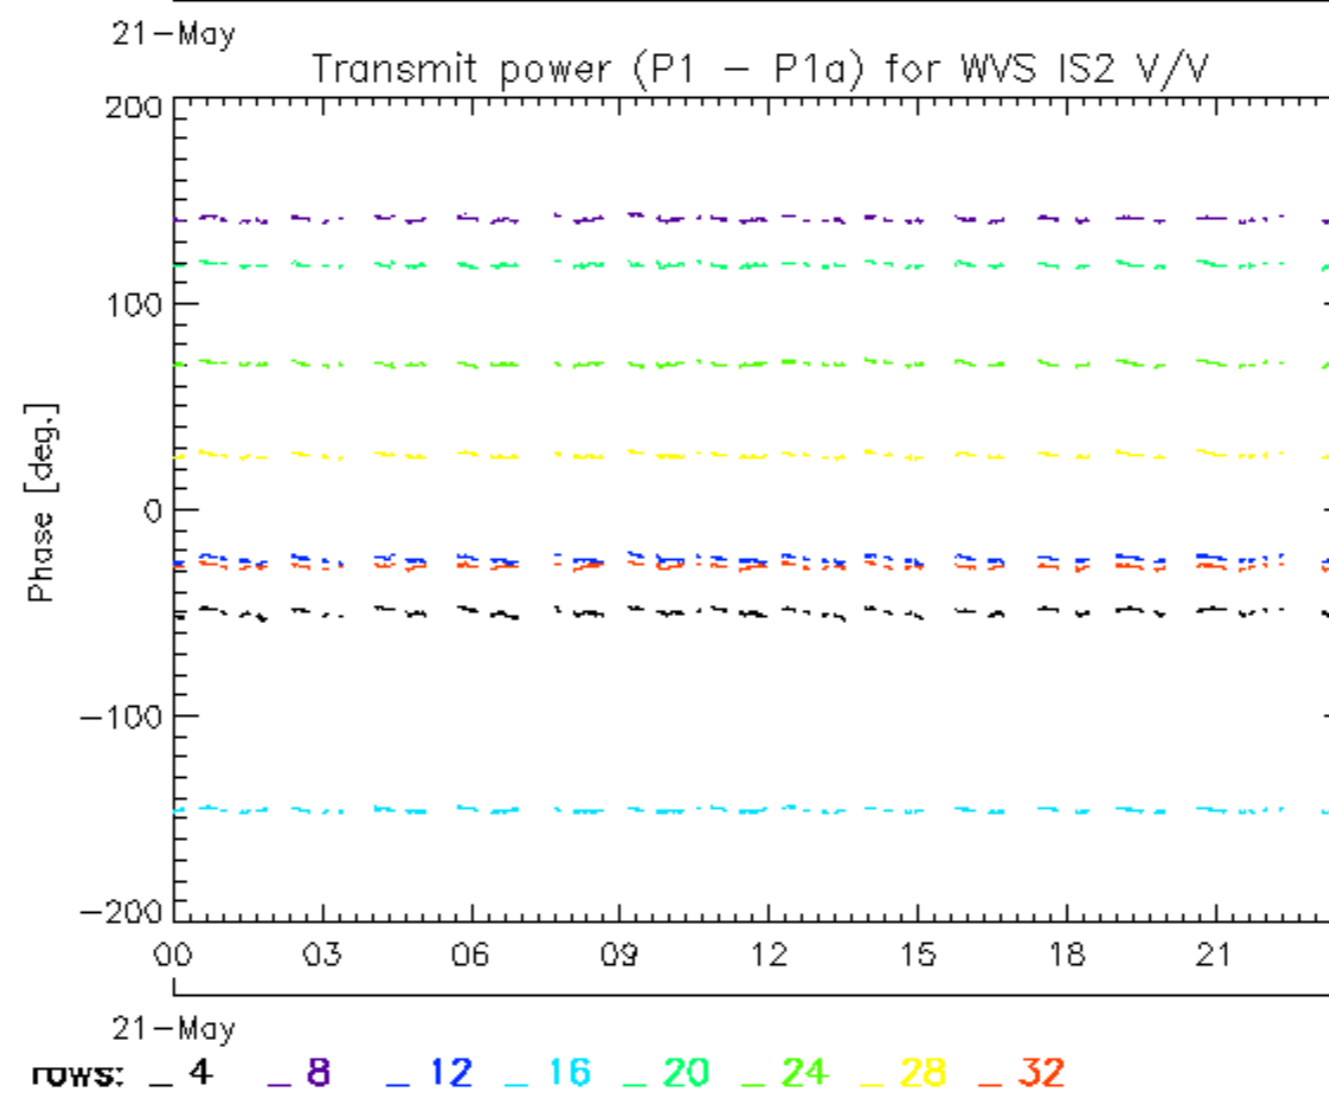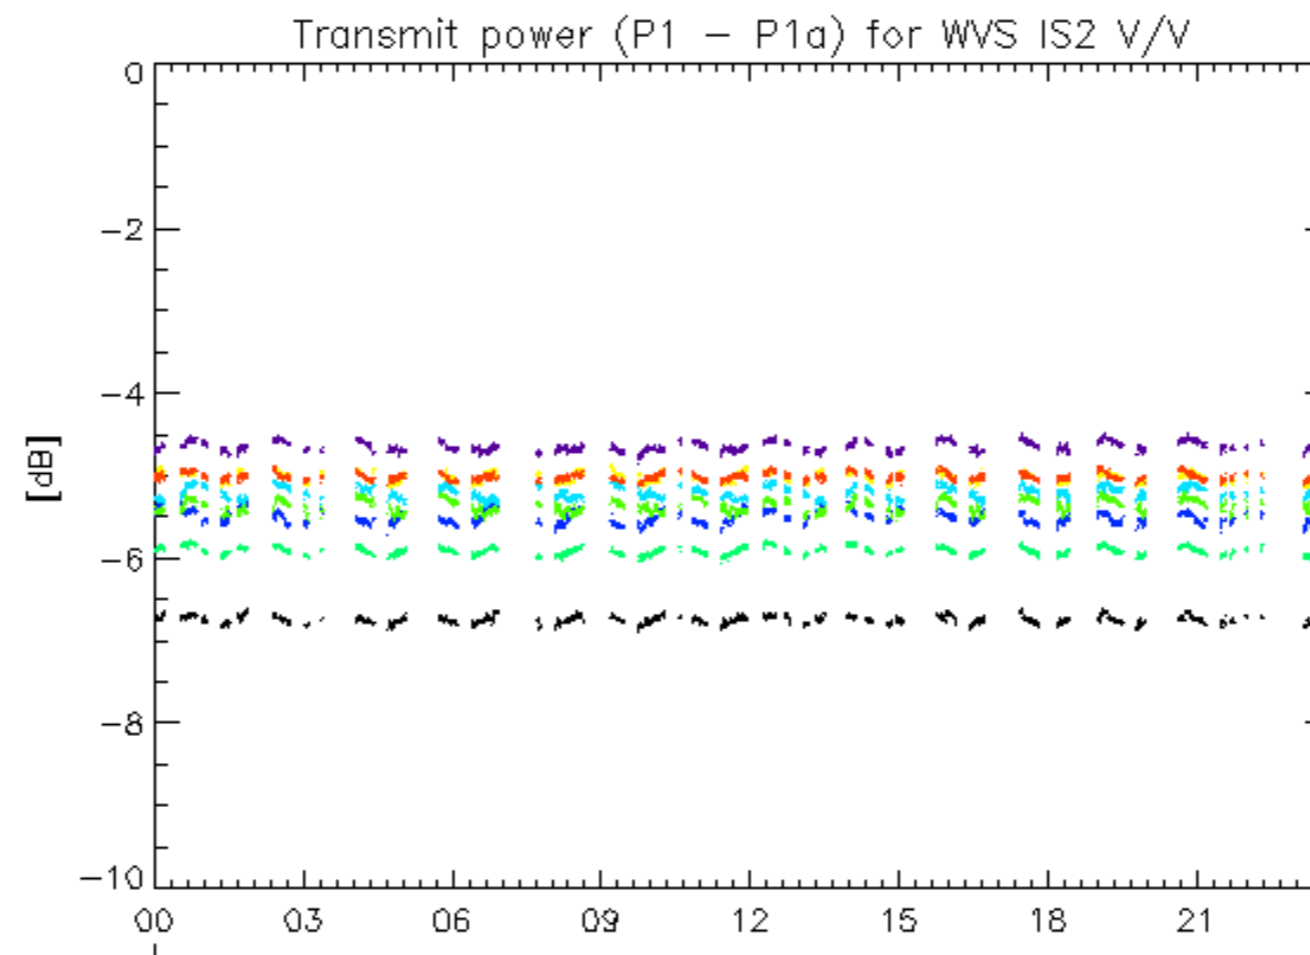

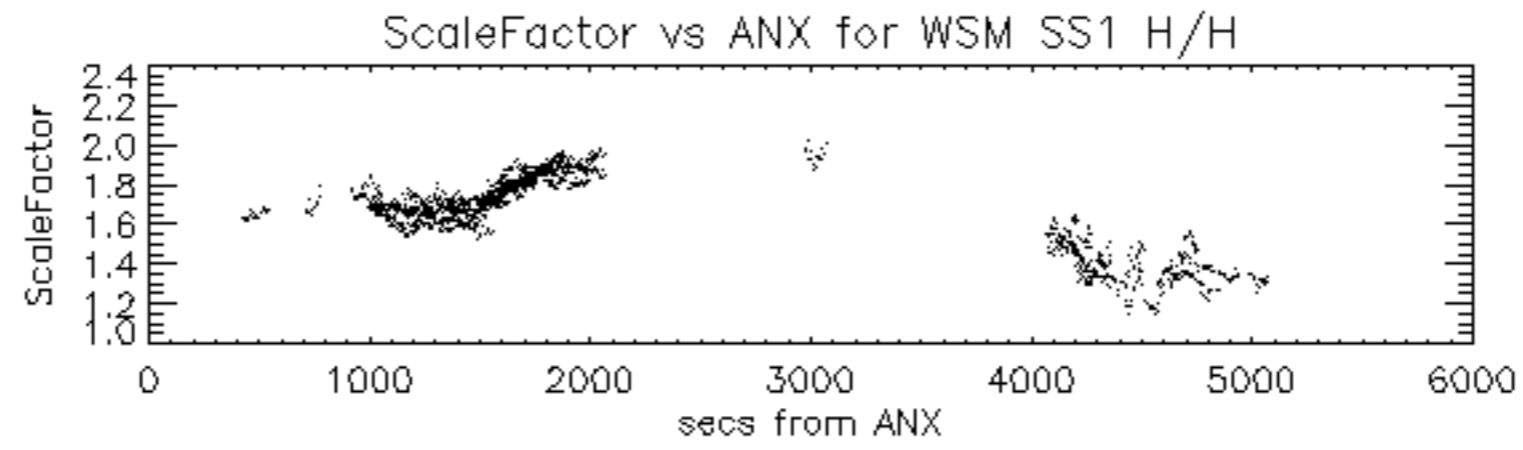

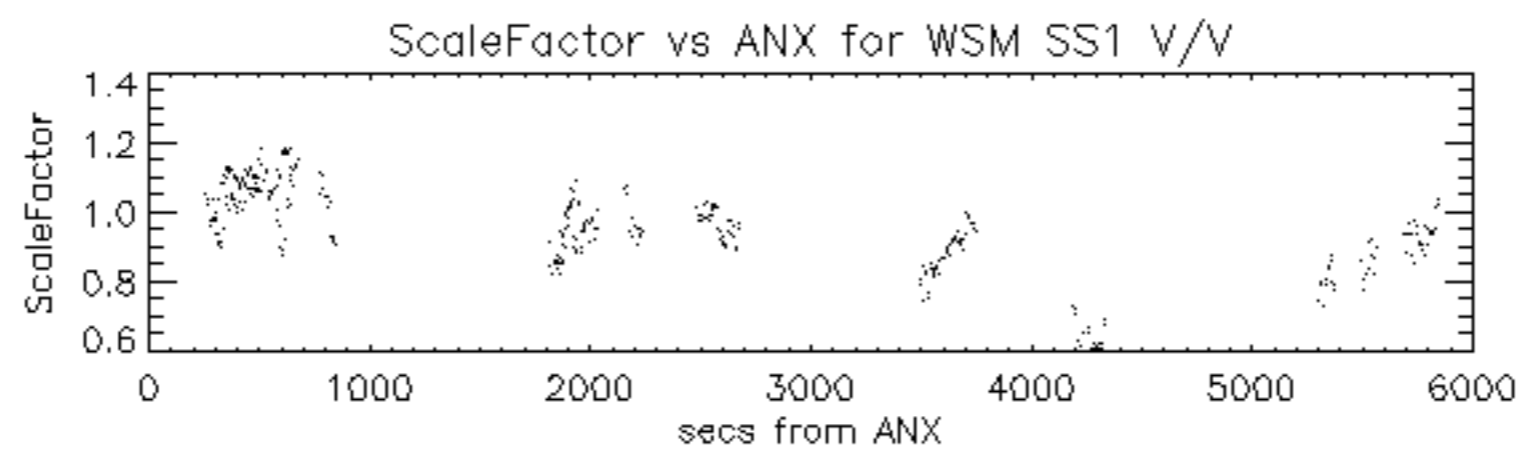

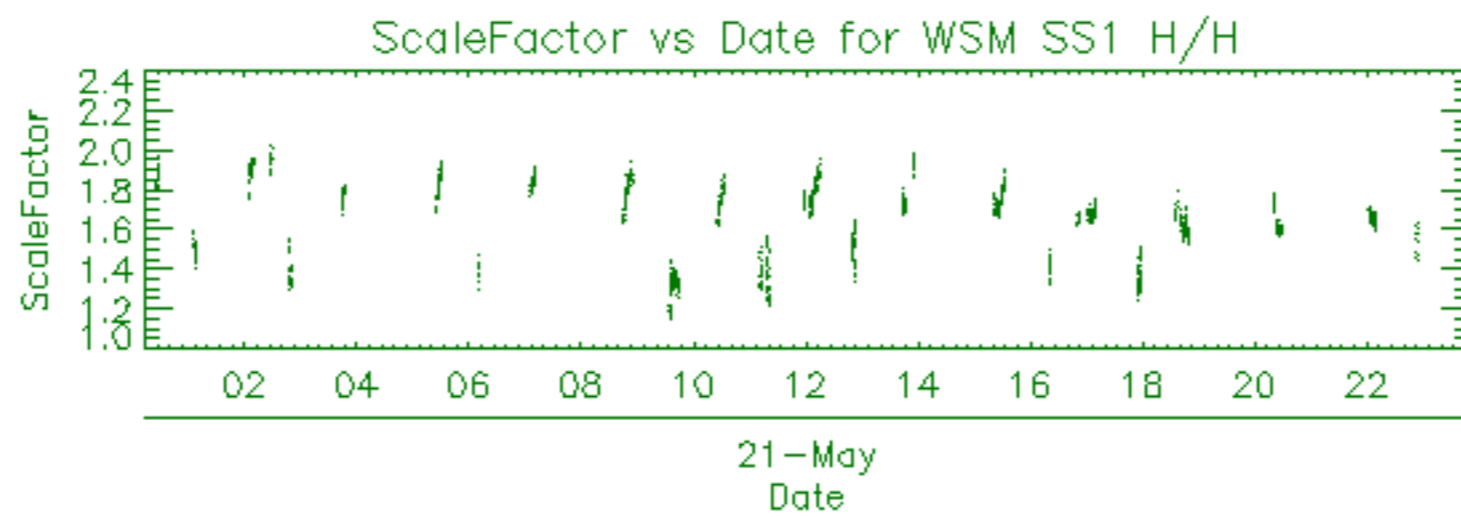

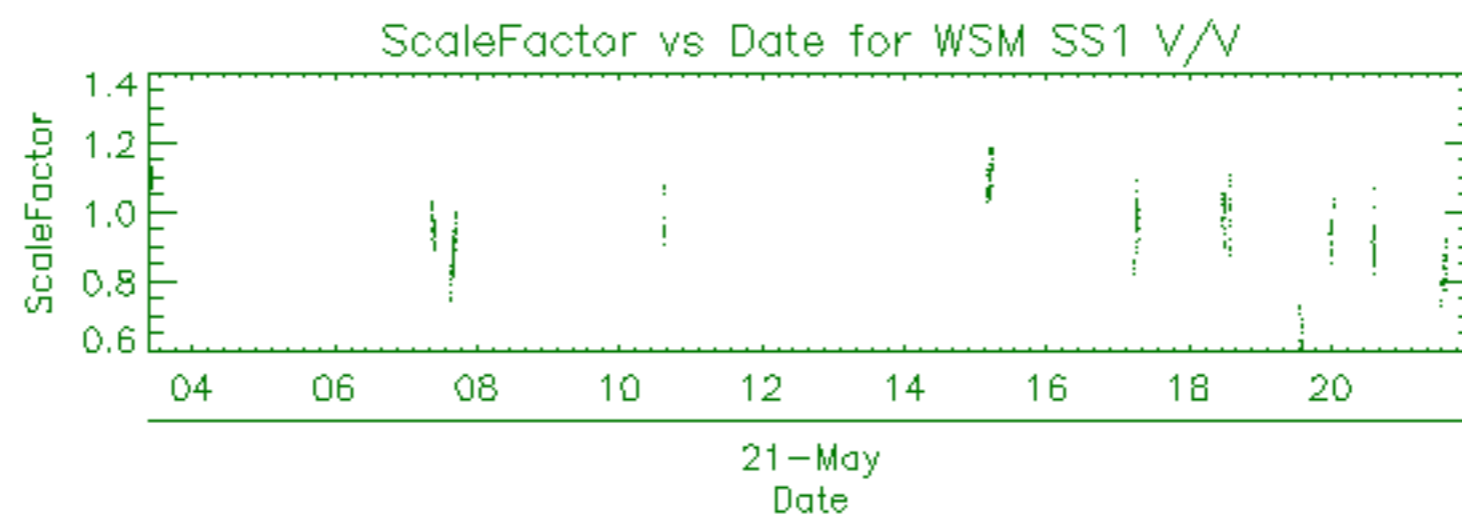

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_APM_1PNPDE20090521_021002_000000742079_00132_37761_4798.N1						IS1	H/H	79	37761	132	4.07
ASA_APM_1PNPDE20090521_021941_000000402079_00132_37761_4789.N1						IS1	H/H	79	37761	132	4.07
ASA_APM_1PNPDE20090521_091042_000000432079_00136_37765_5191.N1						IS2	H/H	79	37765	136	4.07
ASA_APM_1PNPDK20090521_133925_000000412079_00139_37768_5853.N1						IS6	H/H	79	37768	139	4.07

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_GM1_1PNPDE20090521_002102_000002592079_00131_37760_4538.N1						SS1	H/H	79	37760	131	4.07
ASA_GM1_1PNPDE20090521_002900_000001322079_00131_37760_4540.N1						SS1	H/H	79	37760	131	4.07
ASA_GM1_1PNPDE20090521_005106_000003922079_00131_37760_4553.N1						SS1	H/H	79	37760	131	4.07
ASA_GM1_1PNPDE20090521_010851_000002112079_00131_37760_4551.N1						SS1	H/H	79	37760	131	4.07
ASA_GM1_1PNPDE20090521_011604_000002832079_00131_37760_4563.N1						SS1	H/H	79	37760	131	4.07
ASA_GM1_1PNPDE20090521_013100_000005072079_00131_37760_4690.N1						SS1	H/H	79	37760	131	4.07
ASA_GM1_1PNPDE20090521_015157_000004102079_00132_37761_4692.N1						SS1	H/H	79	37761	132	4.07
ASA_GM1_1PNPDE20090521_015945_000002592079_00132_37761_4698.N1						SS1	H/H	79	37761	132	4.07
ASA_GM1_1PNPDE20090521_021136_000003082079_00132_37761_4696.N1						SS1	H/H	79	37761	132	4.07
ASA_GM1_1PNPDE20090521_021817_000000842079_00132_37761_4694.N1						SS1	H/H	79	37761	132	4.07
ASA_GM1_1PNPDE20090521_022044_000000962079_00132_37761_4711.N1						SS1	H/H	79	37761	132	4.07
ASA_GM1_1PNPDE20090521_024522_000000722079_00132_37761_4874.N1						SS1	H/H	79	37761	132	4.07
ASA_GM1_1PNPDE20090521_025057_000006282079_00132_37761_4930.N1						SS1	H/H	79	37761	132	4.07
ASA_GM1_1PNPDE20090521_030554_000001692079_00132_37761_4866.N1						SS1	H/H	79	37761	132	4.07
ASA_GM1_1PNPDE20090521_030846_000007432079_00132_37761_4862.N1						SS1	H/H	79	37761	132	4.07
ASA_GM1_1PNPDE20090521_032712_000007122079_00133_37762_4860.N1						SS1	H/H	79	37762	133	4.07
ASA_GM1_1PNPDE20090521_033955_000002172079_00133_37762_4855.N1						SS1	H/H	79	37762	133	4.07
ASA_GM1_1PNPDE20090521_034706_000005252079_00133_37762_4850.N1						SS1	H/H	79	37762	133	4.07
ASA_GM1_1PNPDE20090521_042558_000009302079_00133_37762_5106.N1						SS1	H/H	79	37762	133	4.07
ASA_GM1_1PNPDE20090521_050358_000003022079_00134_37763_5104.N1						SS1	H/H	79	37763	134	4.07
ASA_GM1_1PNPDE20090521_051119_000001932079_00134_37763_5088.N1						SS1	H/H	79	37763	134	4.07
ASA_GM1_1PNPDE20090521_051534_000005732079_00134_37763_5086.N1						SS1	H/H	79	37763	134	4.07
ASA_GM1_1PNPDE20090521_053130_000003682079_00134_37763_5090.N1						SS1	H/H	79	37763	134	4.07
ASA_GM1_1PNPDK20090521_060634_000001502079_00134_37763_5246.N1						SS1	H/H	79	37763	134	4.07
ASA_GM1_1PNPDK20090521_061052_000007062079_00134_37763_5251.N1						SS1	H/H	79	37763	134	4.07
ASA_GM1_1PNPDK20090521_065601_000005492079_00135_37764_5259.N1						SS1	H/H	79	37764	135	4.07
ASA_GM1_1PNPDK20090521_071539_000001442079_00135_37764_5324.N1						SS1	H/H	79	37764	135	4.07
ASA_GM1_1PNPDK20090521_071849_000001322079_00135_37764_5326.N1						SS1	H/H	79	37764	135	4.07
ASA_GM1_1PNPDK20090521_072703_000006462079_00135_37764_5328.N1						SS1	H/H	79	37764	135	4.07
ASA_GM1_1PNPDK20090521_074827_000008882079_00135_37764_5336.N1						SS1	H/H	79	37764	135	4.07
ASA_GM1_1PNPDK20090521_083820_000004042079_00136_37765_5341.N1						SS1	H/H	79	37765	136	4.07
ASA_GM1_1PNPDK20090521_090434_000003682079_00136_37765_5469.N1						SS1	H/H	79	37765	136	4.07
ASA_GM1_1PNPDK20090521_092746_000003682079_00136_37765_5474.N1						SS1	H/H	79	37765	136	4.07
ASA_GM1_1PNPDK20090521_101751_000004282079_00137_37766_5532.N1						SS1	H/H	79	37766	137	4.07
ASA_GM1_1PNPDK20090521_104303_000003562079_00137_37766_5612.N1						SS1	H/H	79	37766	137	4.07
ASA_GM1_1PNPDK20090521_110822_000001322079_00137_37766_5610.N1						SS1	H/H	79	37766	137	4.07
ASA_GM1_1PNPDK20090521_111358_000001752079_00137_37766_5614.N1						SS1	H/H	79	37766	137	4.07
ASA_GM1_1PNPDK20090521_112132_000001752079_00137_37766_5619.N1						SS1	H/H	79	37766	137	4.07
ASA_GM1_1PNPDK20090521_115954_000002592079_00138_37767_5685.N1						SS1	H/H	79	37767	138	4.07
ASA_GM1_1PNPDK20090521_123357_000004532079_00138_37767_5750.N1						SS1	H/H	79	37767	138	4.07
ASA_GM1_1PNPDK20090521_125355_000006642079_00138_37767_5758.N1						SS1	H/H	79	37767	138	4.07
ASA_GM1_1PNPDK20090521_131047_000004772079_00138_37767_5760.N1						SS1	H/H	79	37767	138	4.07
ASA_GM1_1PNPDK20090521_133248_000003982079_00139_37768_5762.N1						SS1	H/H	79	37768	139	4.07
ASA_GM1_1PNPDK20090521_134028_000001442079_00139_37768_5769.N1						SS1	H/H	79	37768	139	4.07
ASA_GM1_1PNPDK20090521_134822_000003682079_00139_37768_5888.N1						SS1	H/H	79	37768	139	4.07
ASA_GM1_1PNPDK20090521_140934_000002592079_00139_37768_5890.N1						SS1	H/H	79	37768	139	4.07
ASA_GM1_1PNPDK20090521_141534_000002172079_00139_37768_5895.N1						SS1	H/H	79	37768	139	4.07
ASA_GM1_1PNPDK20090521_142934_000009302079_00139_37768_5900.N1						SS1	H/H	79	37768	139	4.07
ASA_GM1_1PNPDK20090521_145359_000001442079_00139_37768_5905.N1						SS1	H/H	79	37768	139	4.07
ASA_GM1_1PNPDK20090521_150512_000002712079_00140_37769_5907.N1						SS1	H/H	79	37769	140	4.07
ASA_GM1_1PNPDK20090521_151422_000004282079_00140_37769_5971.N1						SS1	H/H	79	37769	140	4.07
ASA_GM1_1PNPDK20090521_153310_000007062079_00140_37769_6021.N1						SS1	H/H	79	37769	140	4.07
ASA_GM1_1PNPDK20090521_154710_000001442079_00140_37769_6023.N1						SS1	H/H	79	37769	140	4.07
ASA_GM1_1PNPDK20090521_161010_000005732079_00140_37769_6025.N1						SS1	H/H	79	37769	140	4.07
ASA_GM1_1PNPDK20090521_162220_000002292079_00140_37769_6030.N1						SS1	H/H	79	37769	140	4.07
ASA_GM1_1PNPDK20090521_164553_000002652079_00141_37770_6032.N1						SS1	H/H	79	37770	141	4.07
ASA_GM1_1PNPDK20090521_165331_000003922079_00141_37770_6042.N1						SS1	H/H	79	37770	141	4.07
ASA_GM1_1PNPDK20090521_171021_000001202079_00141_37770_6142.N1						SS1	H/H	79	37770	141	4.07
ASA_GM1_1PNPDK20090521_171734_000005252079_00141_37770_6144.N1						SS1	H/H	79	37770	141	4.07
ASA_GM1_1PNPDK20090521_175046_000002532079_00141_37770_6147.N1						SS1	H/H	79	37770	141	4.07
ASA_GM1_1PNPDK20090521_175856_000002652079_00141_37770_6149.N1						SS1	H/H	79	37770	141	4.07
ASA_GM1_1PNPDK20090521_180508_000001022079_00141_37770_6151.N1						SS1	H/H	79	37770	141	4.07
ASA_GM1_1PNPDK20090521_183122_000001202079_00142_37771_6156.N1						SS1	H/H	79	37771	142	4.07
ASA_GM1_1PNPDK20090521_183858_000001022079_00142_37771_6166.N1						SS1	H/H	79	37771	142	4.07
ASA_GM1_1PNPDK20090521_185009_000005792079_00142_37771_6264.N1						SS1	H/H	79	37771	142	4.07
ASA_GM1_1PNPDK20090521_193122_000001322079_00142_37771_6266.N1						SS1	H/H	79	37771	142	4.07
ASA_GM1_1PNPDK20090521_193631_000002772079_00142_37771_6268.N1						SS1	H/H	79	37771	142	4.07

ASA_GM1_1PNPDK20090521_194542_000001022079_00142_37771_6270.N1	SS1	H/H	79	37771	142	4.07
ASA_GM1_1PNPDK20090521_200142_000006942079_00142_37771_6275.N1	SS1	H/H	79	37771	142	4.07
ASA_GM1_1PNPDE20090521_202941_000002952079_00143_37772_5637.N1	SS1	H/H	79	37772	143	4.07
ASA_GM1_1PNPDE20090521_203715_000000782079_00143_37772_5639.N1	SS1	H/H	79	37772	143	4.07
ASA_GM1_1PNPDE20090521_211158_000005012079_00143_37772_5647.N1	SS1	H/H	79	37772	143	4.07
ASA_GM1_1PNPDE20090521_212551_000001262079_00143_37772_5654.N1	SS1	H/H	79	37772	143	4.07
ASA_GM1_1PNPDE20090521_214605_000005072079_00144_37773_6248.N1	SS1	H/H	79	37773	144	4.07
ASA_GM1_1PNPDE20090521_220934_000004712079_00144_37773_5820.N1	SS1	H/H	79	37773	144	4.07
ASA_GM1_1PNPDE20090521_225722_000001692079_00144_37773_5818.N1	SS1	H/H	79	37773	144	4.07
ASA_GM1_1PNPDE20090521_230553_000001632079_00144_37773_6250.N1	SS1	H/H	79	37773	144	4.07
ASA_GM1_1PNPDE20090521_234932_000007312079_00145_37774_5962.N1	SS1	H/H	79	37774	145	4.07

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20090521_001453_000000632079_00131_37760_4644.N1						IS2	H/H	79	37760	131	4.07
ASA_IMM_1PNPDE20090521_001453_000002022079_00131_37760_4673.N1						IS2	H/H	79	37760	131	4.07
ASA_IMM_1PNPDE20090521_001756_000000192079_00131_37760_4650.N1						IS2	***	79	37760	131	4.07
ASA_IMM_1PNPDE20090521_011221_000000632079_00131_37760_4636.N1						IS2	H/H	79	37760	131	4.07
ASA_IMM_1PNPDE20090521_011221_000002112079_00131_37760_4665.N1						IS2	H/H	79	37760	131	4.07
ASA_IMM_1PNPDE20090521_011524_000000282079_00131_37760_4642.N1						IS2	H/H	79	37760	131	4.07
ASA_IMM_1PNPDE20090521_015848_000000462079_00132_37761_4681.N1						IS2	H/H	79	37761	132	4.07
ASA_IMM_1PNPDE20090521_021644_000000822079_00132_37761_4820.N1						IS2	V/V	79	37761	132	4.07
ASA_IMM_1PNPDE20090521_033905_000000382079_00133_37762_4864.N1						IS6	V/V	79	37762	133	4.07
ASA_IMM_1PNPDE20090521_035552_000003912079_00133_37762_4973.N1						IS2	V/V	79	37762	133	4.07
ASA_IMM_1PNPDE20090521_050859_000001282079_00134_37763_4991.N1						IS2	V/V	79	37763	134	4.07
ASA_IMM_1PNPDE20090521_051431_000000502079_00134_37763_4971.N1						IS6	V/V	79	37763	134	4.07
ASA_IMM_1PNPDE20090521_053735_000002352079_00134_37763_5070.N1						IS2	V/V	79	37763	134	4.07
ASA_IMM_1PNPDE20090521_055115_000000532079_00134_37763_4975.N1						IS2	V/V	79	37763	134	4.07
ASA_IMM_1PNPDK20090521_071107_000002622079_00135_37764_5317.N1						IS2	H/H	79	37764	135	4.07
ASA_IMM_1PNPDE20090521_071801_000000372079_00135_37764_5108.N1						IS2	V/V	79	37764	135	4.07
ASA_IMM_1PNPDE20090521_072531_000000622079_00135_37764_5135.N1						IS4	H/H	79	37764	135	4.07
ASA_IMM_1PNPDE20090521_072531_000000812079_00135_37764_5195.N1						IS4	H/H	79	37764	135	4.07
ASA_IMM_1PNPDK20090521_082515_000000442079_00136_37765_5415.N1						IS4	V/V	79	37765	136	4.07
ASA_IMM_1PNPDK20090521_085514_000001712079_00136_37765_5450.N1						IS2	V/V	79	37765	136	4.07
ASA_IMM_1PNPDE20090521_123224_000000812079_00138_37767_5314.N1						IS7	V/V	79	37767	138	4.07
ASA_IMM_1PNPDE20090521_123224_000000812079_00138_37767_5316.N1						IS7	V/V	79	37767	138	4.07
ASA_IMM_1PNPDE20090521_145311_000000372079_00139_37768_5390.N1						IS3	V/V	79	37768	139	4.07
ASA_IMM_1PNPDE20090521_164412_000000772079_00141_37770_5440.N1						IS2	V/V	79	37770	141	4.07
ASA_IMM_1PNPDE20090521_165232_000000472079_00141_37770_5404.N1						IS6	V/V	79	37770	141	4.07
ASA_IMM_1PNPDE20090521_171219_000000402079_00141_37770_5430.N1						IS5	H/H	79	37770	141	4.07
ASA_IMM_1PNPDE20090521_180320_000000982079_00141_37770_5436.N1						IS2	H/H	79	37770	141	4.07
ASA_IMM_1PNPDE20090521_194107_000000632079_00142_37771_5507.N1						IS2	H/H	79	37771	142	4.07
ASA_IMM_1PNPDE20090521_194107_000000632079_00142_37771_5611.N1						IS2	H/H	79	37771	142	4.07
ASA_IMM_1PNPDE20090521_194107_000000632079_00142_37771_5667.N1						IS2	H/H	79	37771	142	4.07
ASA_IMM_1PNPDE20090521_194107_000002652079_00142_37771_6198.N1						IS2	H/H	79	37771	142	4.07
ASA_IMM_1PNPDE20090521_194310_000000602079_00142_37771_5671.N1						IS2	H/H	79	37771	142	4.07
ASA_IMM_1PNPDE20090521_194411_000000592079_00142_37771_5513.N1						IS2	H/H	79	37771	142	4.07
ASA_IMM_1PNPDK20090521_201708_000001152079_00143_37772_6356.N1						IS2	V/V	79	37772	143	4.07
ASA_IMM_1PNPDE20090521_212016_000003242079_00143_37772_6252.N1						IS2	H/H	79	37772	143	4.07
ASA_IMM_1PNPDE20090521_212219_000001192079_00143_37772_5830.N1						IS2	H/H	79	37772	143	4.07
ASA_IMM_1PNPDE20090521_215429_000000632079_00144_37773_5752.N1						IS2	H/H	79	37773	144	4.07
ASA_IMM_1PNPDE20090521_215429_000000682079_00144_37773_6200.N1						IS2	H/H	79	37773	144	4.07
ASA_IMM_1PNPDE20090521_222019_000000592079_00144_37773_5910.N1						IS2	V/V	79	37773	144	4.07
ASA_IMM_1PNPDE20090521_230008_000003342079_00144_37773_5951.N1						IS2	H/H	79	37773	144	4.07
ASA_IMM_1PNPDE20090521_232948_000000532079_00145_37774_5990.N1						IS2	V/V	79	37774	145	4.07
ASA_IMM_1PNPDE20090521_233604_000000532079_00145_37774_5912.N1						IS2	V/V	79	37774	145	4.07


Filename	Pol	Timestamp	count(Module)
ASA_MS__0PNPDK20090521_074709_000000162079_00135_37764_0814.N1	V	2009-05-21 07:47:09	320





Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WSM_1PNPDE20090521_001318_000000672079_00131_37760_4632.N1						SS1	H/H	79	37760	131	4.07
ASA_WSM_1PNPDE20090521_002526_000000732079_00131_37760_4654.N1						SS1	H/H	79	37760	131	4.07
ASA_WSM_1PNPDE20090521_002526_000001892079_00131_37760_4822.N1						SS1	H/H	79	37760	131	4.07
ASA_WSM_1PNPDE20090521_010529_000001892079_00131_37760_4660.N1						SS1	H/H	79	37760	131	4.07
ASA_WSM_1PNPDE20090521_020409_000003302079_00132_37761_4949.N1						SS1	H/H	79	37761	132	4.07
ASA_WSM_1PNPDE20090521_020623_000000552079_00132_37761_4812.N1						SS1	H/H	79	37761	132	4.07
ASA_WSM_1PNPDE20090521_020921_000000182079_00132_37761_4818.N1						SS1	H/H	79	37761	132	4.07
ASA_WSM_1PNPDE20090521_022723_000001162079_00132_37761_4787.N1						SS1	H/H	79	37761	132	4.07
ASA_WSM_1PNPDE20090521_024637_000002502079_00132_37761_4824.N1						SS1	H/H	79	37761	132	4.07
ASA_WSM_1PNPDE20090521_032321_000000732079_00133_37762_4941.N1						SS1	V/V	79	37762	133	4.07
ASA_WSM_1PNPDE20090521_032321_000002252079_00133_37762_5133.N1						SS1	V/V	79	37762	133	4.07
ASA_WSM_1PNPDE20090521_034337_000000732079_00133_37762_4932.N1						SS1	H/H	79	37762	133	4.07
ASA_WSM_1PNPDE20090521_034337_000001892079_00133_37762_5156.N1						SS1	H/H	79	37762	133	4.07
ASA_WSM_1PNPDE20090521_052511_000002502079_00134_37763_5158.N1						SS1	H/H	79	37763	134	4.07
ASA_WSM_1PNPDE20090521_052511_000003732079_00134_37763_5228.N1						SS1	H/H	79	37763	134	4.07
ASA_WSM_1PNPDK20090521_052654_000002132079_00134_37763_5601.N1						SS1	H/H	79	37763	134	4.07
ASA_WSM_1PNPDE20090521_060911_000000982079_00134_37763_5075.N1						SS1	H/H	79	37763	134	4.07
ASA_WSM_1PNPDE20090521_070513_000000912079_00135_37764_5178.N1						SS1	H/H	79	37764	135	4.07
ASA_WSM_1PNPDK20090521_070611_000002872079_00135_37764_5321.N1						SS1	H/H	79	37764	135	4.07
ASA_WSM_1PNPDE20090521_070626_000000182079_00135_37764_5112.N1						SS1	H/H	79	37764	135	4.07
ASA_WSM_1PNPDE20090521_072105_000002132079_00135_37764_5170.N1						SS1	V/V	79	37764	135	4.07
ASA_WSM_1PNPDE20090521_073752_000002692079_00135_37764_5193.N1						SS1	V/V	79	37764	135	4.07
ASA_WSM_1PNPDK20090521_084510_000002862079_00136_37765_5461.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDK20090521_085051_000002512079_00136_37765_5463.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDE20090521_093401_000000732079_00136_37765_5349.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDE20090521_093401_000001342079_00136_37765_5374.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDE20090521_093401_000005312079_00136_37765_5438.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDE20090521_093401_000000732079_00136_37765_5764.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDE20090521_093514_000000612079_00136_37765_6285.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDE20090521_093615_000003552079_00136_37765_5914.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDE20090521_093710_000000612079_00136_37765_5355.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDE20090521_093811_000001232079_00136_37765_6420.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDE20090521_093913_000000612079_00136_37765_5328.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDE20090521_093913_000001212079_00136_37765_5372.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDE20090521_094014_000001572079_00136_37765_5631.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDE20090521_094210_000000422079_00136_37765_5365.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDE20090521_094322_000001032079_00136_37765_5312.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDE20090521_094322_000001032079_00136_37765_5347.N1						SS1	H/H	79	37765	136	4.07
ASA_WSM_1PNPDK20090521_102506_000005512079_00137_37766_5605.N1						SS1	H/H	79	37766	137	4.07
ASA_WSM_1PNPDK20090521_103647_000000732079_00137_37766_5561.N1						SS1	V/V	79	37766	137	4.07
ASA_WSM_1PNPDE20090521_103654_000000912079_00137_37766_5310.N1						SS1	V/V	79	37766	137	4.07
ASA_WSM_1PNPDE20090521_103654_000000732079_00137_37766_5292.N1						SS1	V/V	79	37766	137	4.07
ASA_WSM_1PNPDE20090521_103654_000000912079_00137_37766_5367.N1						SS1	V/V	79	37766	137	4.07
ASA_WSM_1PNPDE20090521_111040_000001892079_00137_37766_5422.N1						SS1	H/H	79	37766	137	4.07
ASA_WSM_1PNPDE20090521_111040_000001892079_00137_37766_5597.N1						SS1	H/H	79	37766	137	4.07
ASA_WSM_1PNPDE20090521_111153_000000612079_00137_37766_5342.N1						SS1	H/H	79	37766	137	4.07
ASA_WSM_1PNPDE20090521_111254_000000552079_00137_37766_5276.N1						SS1	H/H	79	37766	137	4.07
ASA_WSM_1PNPDE20090521_111658_000000732079_00137_37766_5282.N1						SS1	H/H	79	37766	137	4.07
ASA_WSM_1PNPDE20090521_111658_000002692079_00137_37766_5378.N1						SS1	H/H	79	37766	137	4.07
ASA_WSM_1PNPDE20090521_111658_000000732079_00137_37766_5621.N1						SS1	H/H	79	37766	137	4.07
ASA_WSM_1PNPDE20090521_112008_000000612079_00137_37766_5627.N1						SS1	H/H	79	37766	137	4.07
ASA_WSM_1PNPDE20090521_112109_000000182079_00137_37766_5304.N1						SS1	H/H	79	37766	137	4.07
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5252.N1						SS1	H/H	79	37767	138	4.07
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5256.N1						SS1	H/H	79	37767	138	4.07
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5537.N1						SS1	H/H	79	37767	138	4.07
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5593.N1						SS1	H/H	79	37767	138	4.07
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5599.N1						SS1	H/H	79	37767	138	4.07
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_5633.N1						SS1	H/H	79	37767	138	4.07
ASA_WSM_1PNPDE20090521_115820_000000732079_00138_37767_6211.N1						SS1	H/H	79	37767	138	4.07
ASA_WSM_1PNPDK20090521_120419_000000922079_00138_37767_5710.N1						SS1	H/H	79	37767	138	4.07
ASA_WSM_1PNPDK20090521_120622_000005202079_00138_37767_5745.N1						SS1	H/H	79	37767	138	4.07
ASA_WSM_1PNPDK20090521_124920_000002692079_00138_37767_5886.N1						SS1	H/H	79	37767	138	4.07
ASA_WSM_1PNPDK20090521_134256_000003122079_00139_37768_5884.N1						SS1	H/H	79	37768	139	4.07
ASA_WSM_1PNPDE20090521_135436_000001352079_00139_37768_5519.N1						SS1	H/H	79	37768	139	4.07
ASA_WSM_1PNPDE20090521_150950_000001892079_00140_37769_5424.N1						SS1	V/V	79	37769	140	4.07
ASA_WSM_1PNPDE20090521_150950_000002502079_00140_37769_5489.N1						SS1	V/V	79	37769	140	4.07
ASA_WSM_1PNPDK20090521_152132_000005512079_00140_37769_6016.N1						SS1	H/H	79	37769	140	4.07


ASA_WSM_1PNPDE20090521_153116_000001102079_00140_37769_5491.N1	SS1	H/H	79	37769	140	4.07
ASA_WSM_1PNPDE20090521_161946_000001532079_00140_37769_5418.N1	SS1	H/H	79	37769	140	4.07
ASA_WSM_1PNPDE20090521_165022_000001352079_00141_37770_5517.N1	SS1	H/H	79	37770	141	4.07
ASA_WSM_1PNPDE20090521_165136_0000006122079_00141_37770_5408.N1	SS1	H/H	79	37770	141	4.07
ASA_WSM_1PNPDK20090521_170008_000006122079_00141_37770_6140.N1	SS1	H/H	79	37770	141	4.07
ASA_WSM_1PNPDE20090521_171400_000002082079_00141_37770_5470.N1	SS1	V/V	79	37770	141	4.07
ASA_WSM_1PNPDE20090521_175501_000001902079_00141_37770_5485.N1	SS1	H/H	79	37770	141	4.07
ASA_WSM_1PNPDE20090521_175501_000002262079_00141_37770_5591.N1	SS1	H/H	79	37770	141	4.07
ASA_WSM_1PNPDE20090521_182807_000000922079_00142_37771_5609.N1	SS1	V/V	79	37771	142	4.07
ASA_WSM_1PNPDE20090521_182905_000001342079_00142_37771_5493.N1	SS1	V/V	79	37771	142	4.07
ASA_WSM_1PNPDE20090521_183326_000000972079_00142_37771_5487.N1	SS1	V/V	79	37771	142	4.07
ASA_WSM_1PNPDE20090521_183541_000000732079_00142_37771_5462.N1	SS1	H/H	79	37771	142	4.07
ASA_WSM_1PNPDE20090521_183541_000000912079_00142_37771_5475.N1	SS1	H/H	79	37771	142	4.07
ASA_WSM_1PNPDK20090521_184044_000005512079_00142_37771_6262.N1	SS1	H/H	79	37771	142	4.07
ASA_WSM_1PNPDE20090521_193341_000001342079_00142_37771_5579.N1	SS1	V/V	79	37771	142	4.07
ASA_WSM_1PNPDE20090521_193341_000001652079_00142_37771_5760.N1	SS1	V/V	79	37771	142	4.07
ASA_WSM_1PNPDE20090521_195839_000000732079_00142_37771_5541.N1	SS1	V/V	79	37771	142	4.07
ASA_WSM_1PNPDE20090521_195839_000000732079_00142_37771_5641.N1	SS1	V/V	79	37771	142	4.07
ASA_WSM_1PNPDE20090521_195839_000001762079_00142_37771_6205.N1	SS1	V/V	79	37771	142	4.07
ASA_WSM_1PNPDK20090521_201941_000005932079_00143_37772_6387.N1	SS1	H/H	79	37772	143	4.07
ASA_WSM_1PNPDE20090521_203441_000000732079_00143_37772_5743.N1	SS1	V/V	79	37772	143	4.07
ASA_WSM_1PNPDE20090521_203441_000001532079_00143_37772_6235.N1	SS1	V/V	79	37772	143	4.07
ASA_WSM_1PNPDE20090521_213251_000000912079_00143_37772_5762.N1	SS1	V/V	79	37772	143	4.07
ASA_WSM_1PNPDE20090521_213559_000000732079_00143_37772_5782.N1	SS1	V/V	79	37772	143	4.07
ASA_WSM_1PNPDE20090521_215757_000000922079_00144_37773_5802.N1	SS1	V/V	79	37773	144	4.07
ASA_WSM_1PNPDK20090521_220156_000004522079_00144_37773_6405.N1	SS1	H/H	79	37773	144	4.07
ASA_WSM_1PNPDE20090521_225248_000000732079_00144_37773_5931.N1	SS1	H/H	79	37773	144	4.07
ASA_WSM_1PNPDE20090521_234206_000000732079_00145_37774_6067.N1	SS1	H/H	79	37774	145	4.07
ASA_WSM_1PNPDK20090521_234357_000002202079_00145_37774_6415.N1	SS1	H/H	79	37774	145	4.07
ASA_WSM_1PNPDE20090521_234702_000001352079_00145_37774_6080.N1	SS1	H/H	79	37774	145	4.07




Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20090520_234515_000016342079_00130_37759_4543.N1						IS2	V/V	79	37759	130	4.07
ASA_WVS_1PNPDE20090521_003117_000011442079_00131_37760_4546.N1						IS2	V/V	79	37760	131	4.07
ASA_WVS_1PNPDE20090521_005738_000003902079_00131_37760_4549.N1						IS2	V/V	79	37760	131	4.07
ASA_WVS_1PNPDE20090521_012051_000002702079_00131_37760_4561.N1						IS2	V/V	79	37760	131	4.07
ASA_WVS_1PNPDE20090521_012436_000003452079_00131_37760_4688.N1						IS2	V/V	79	37760	131	4.07
ASA_WVS_1PNPDE20090521_013931_000007042079_00132_37761_4704.N1						IS2	V/V	79	37761	132	4.07
ASA_WVS_1PNPDE20090521_022228_000002542079_00132_37761_4701.N1						IS2	V/V	79	37761	132	4.07
ASA_WVS_1PNPDE20090521_022920_000008242079_00132_37761_4714.N1						IS2	V/V	79	37761	132	4.07
ASA_WVS_1PNPDE20090521_024235_000001202079_00132_37761_4872.N1						IS2	V/V	79	37761	132	4.07
ASA_WVS_1PNPDE20090521_030127_000002252079_00132_37761_4869.N1						IS2	V/V	79	37761	132	4.07
ASA_WVS_1PNPDE20090521_032115_000000892079_00133_37762_4853.N1						IS2	V/V	79	37762	133	4.07
ASA_WVS_1PNPDE20090521_040310_000009892079_00133_37762_4858.N1						IS2	V/V	79	37762	133	4.07
ASA_WVS_1PNPDE20090521_041909_000001202079_00133_37762_5115.N1						IS2	V/V	79	37762	133	4.07
ASA_WVS_1PNPDE20090521_040310_000009892079_00133_37762_4858.N1						IS1	V/V	79	37762	133	4.07
ASA_WVS_1PNPDE20090521_042412_000000602079_00133_37762_5102.N1						IS2	V/V	79	37762	133	4.07
ASA_WVS_1PNPDE20090521_044203_000012742079_00133_37762_5099.N1						IS2	V/V	79	37762	133	4.07
ASA_WVS_1PNPDE20090521_054228_000004942079_00134_37763_5123.N1						IS2	V/V	79	37763	134	4.07
ASA_WVS_1PNPDE20090521_055213_000004792079_00134_37763_5084.N1						IS2	V/V	79	37763	134	4.07
ASA_WVS_1PNPDK20090521_055958_000003452079_00134_37763_5249.N1						IS2	V/V	79	37763	134	4.07
ASA_WVS_1PNPDK20090521_062239_000019642079_00134_37763_5268.N1						IS2	V/V	79	37763	134	4.07
ASA_WVS_1PNPDK20090521_074223_000002402079_00135_37764_5331.N1						IS2	V/V	79	37764	135	4.07
ASA_WVS_1PNPDK20090521_080315_000012892079_00135_37764_5334.N1						IS2	V/V	79	37764	135	4.07
ASA_WVS_1PNPDK20090521_082606_000006892079_00136_37765_5339.N1						IS2	V/V	79	37765	136	4.07
ASA_WVS_1PNPDK20090521_091131_000009292079_00136_37765_5472.N1						IS2	V/V	79	37765	136	4.07
ASA_WVS_1PNPDK20090521_094508_000019192079_00136_37765_5482.N1						IS2	V/V	79	37765	136	4.07
ASA_WVS_1PNPDK20090521_103425_000001052079_00137_37766_5608.N1						IS2	V/V	79	37766	137	4.07
ASA_WVS_1PNPDK20090521_104902_000011092079_00137_37766_5617.N1						IS2	V/V	79	37766	137	4.07
ASA_WVS_1PNPDK20090521_112427_000019492079_00137_37766_5700.N1						IS2	V/V	79	37766	137	4.07
ASA_WVS_1PNPDK20090521_121501_000010042079_00138_37767_5748.N1						IS2	V/V	79	37767	138	4.07
ASA_WVS_1PNPDK20090521_124133_000004052079_00138_37767_5753.N1						IS2	V/V	79	37767	138	4.07
ASA_WVS_1PNPDK20090521_130503_000003002079_00138_37767_5756.N1						IS2	V/V	79	37767	138	4.07
ASA_WVS_1PNPDK20090521_131843_000007272079_00138_37767_5784.N1						IS2	V/V	79	37767	138	4.07
ASA_WVS_1PNPDK20090521_135655_000007192079_00139_37768_5893.N1						IS2	V/V	79	37768	139	4.07
ASA_WVS_1PNPDK20090521_141915_000005702079_00139_37768_5898.N1						IS2	V/V	79	37768	139	4.07
ASA_WVS_1PNPDK20090521_144538_000003752079_00139_37768_5903.N1						IS2	V/V	79	37768	139	4.07
ASA_WVS_1PNPDK20090521_145628_000004792079_00139_37768_5969.N1						IS2	V/V	79	37768	139	4.07
ASA_WVS_1PNPDK20090521_154458_000000892079_00140_37769_6019.N1						IS2	V/V	79	37769	140	4.07
ASA_WVS_1PNPDK20090521_154934_000011842079_00140_37769_6028.N1						IS2	V/V	79	37769	140	4.07
ASA_WVS_1PNPDK20090521_162614_000010342079_00140_37769_6035.N1						IS2	V/V	79	37769	140	4.07
ASA_WVS_1PNPDK20090521_172624_000014242079_00141_37770_6154.N1						IS2	V/V	79	37770	141	4.07
ASA_WVS_1PNPDK20090521_181023_000010192079_00141_37770_6159.N1						IS2	V/V	79	37770	141	4.07
ASA_WVS_1PNPDK20090521_185952_000018442079_00142_37771_6273.N1						IS2	V/V	79	37771	142	4.07
ASA_WVS_1PNPDK20090521_194726_000006302079_00142_37771_6278.N1						IS2	V/V	79	37771	142	4.07
ASA_WVS_1PNPDE20090521_203838_000019492079_00143_37772_5657.N1						IS2	V/V	79	37772	143	4.07
ASA_WVS_1PNPDE20090521_212802_000002402079_00143_37772_5660.N1						IS2	V/V	79	37772	143	4.07
ASA_WVS_1PNPDE20090521_213421_000000442079_00143_37772_6246.N1						IS2	V/V	79	37772	143	4.07
ASA_WVS_1PNPDE20090521_214033_000002842079_00143_37772_5808.N1						IS2	V/V	79	37772	143	4.07
ASA_WVS_1PNPDE20090521_215929_000001052079_00144_37773_5811.N1						IS2	V/V	79	37773	144	4.07
ASA_WVS_1PNPDE20090521_221728_000001352079_00144_37773_5814.N1						IS2	V/V	79	37773	144	4.07
ASA_WVS_1PNPDE20090521_230838_000003152079_00144_37773_5828.N1						IS2	V/V	79	37773	144	4.07
ASA_WVS_1PNPDE20090521_231308_000009592079_00144_37773_5957.N1						IS2	V/V	79	37773	144	4.07
ASA_WVS_1PNPDE20090521_233046_000002842079_00145_37774_5954.N1						IS2	V/V	79	37774	145	4.07
ASA_WVS_1PNPDE20090521_233702_000002552079_00145_37774_5960.N1						IS2	V/V	79	37774	145	4.07



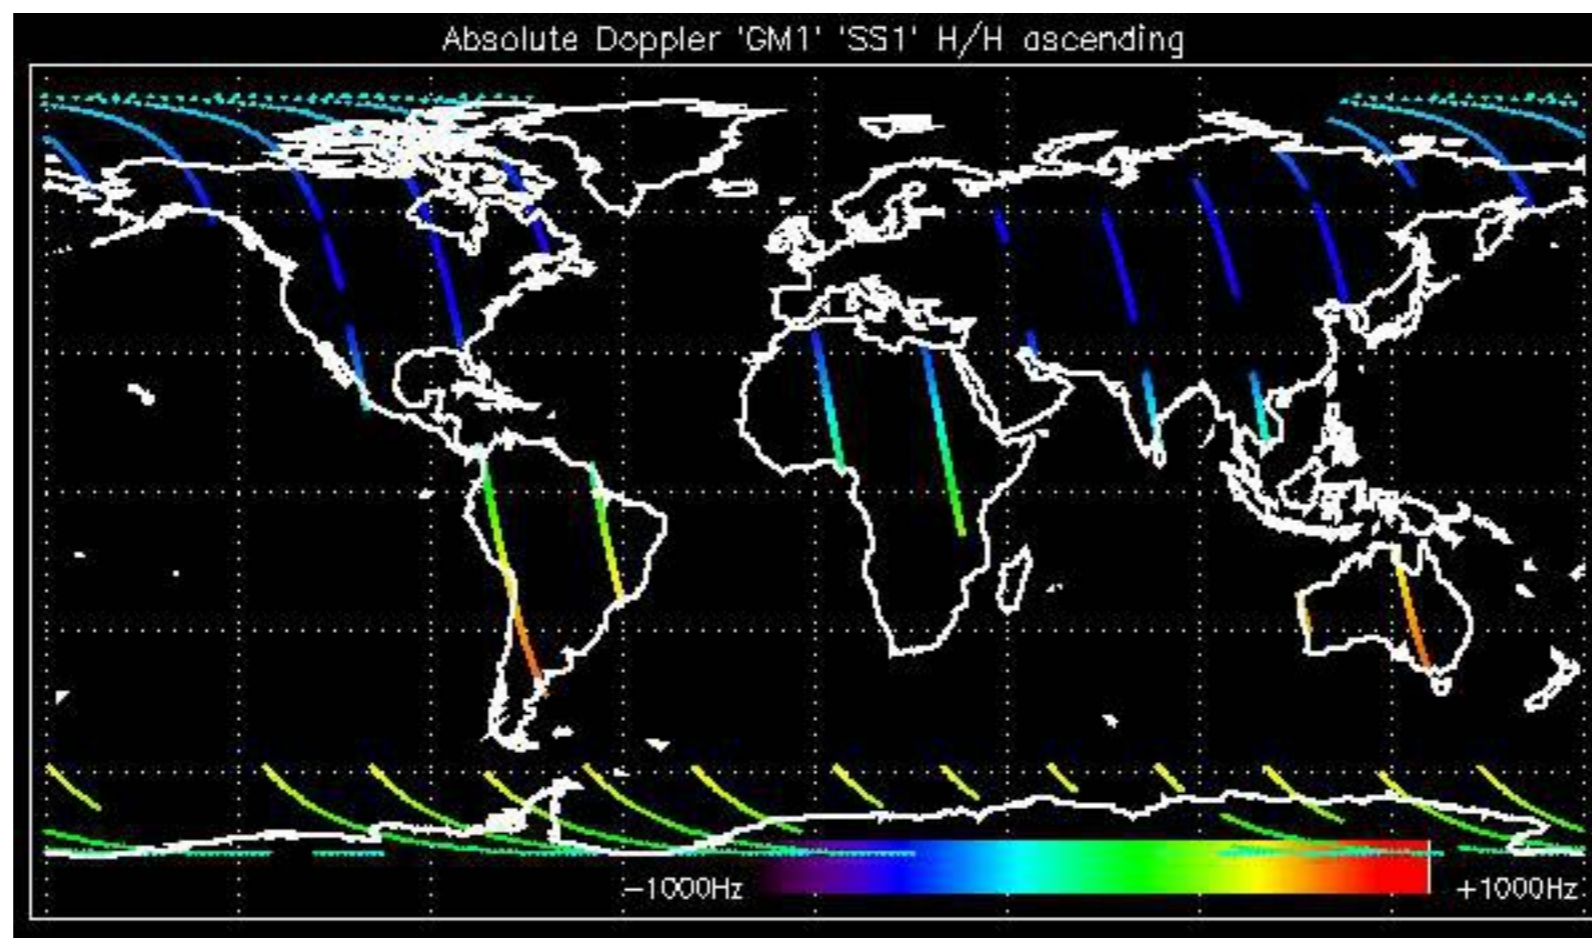


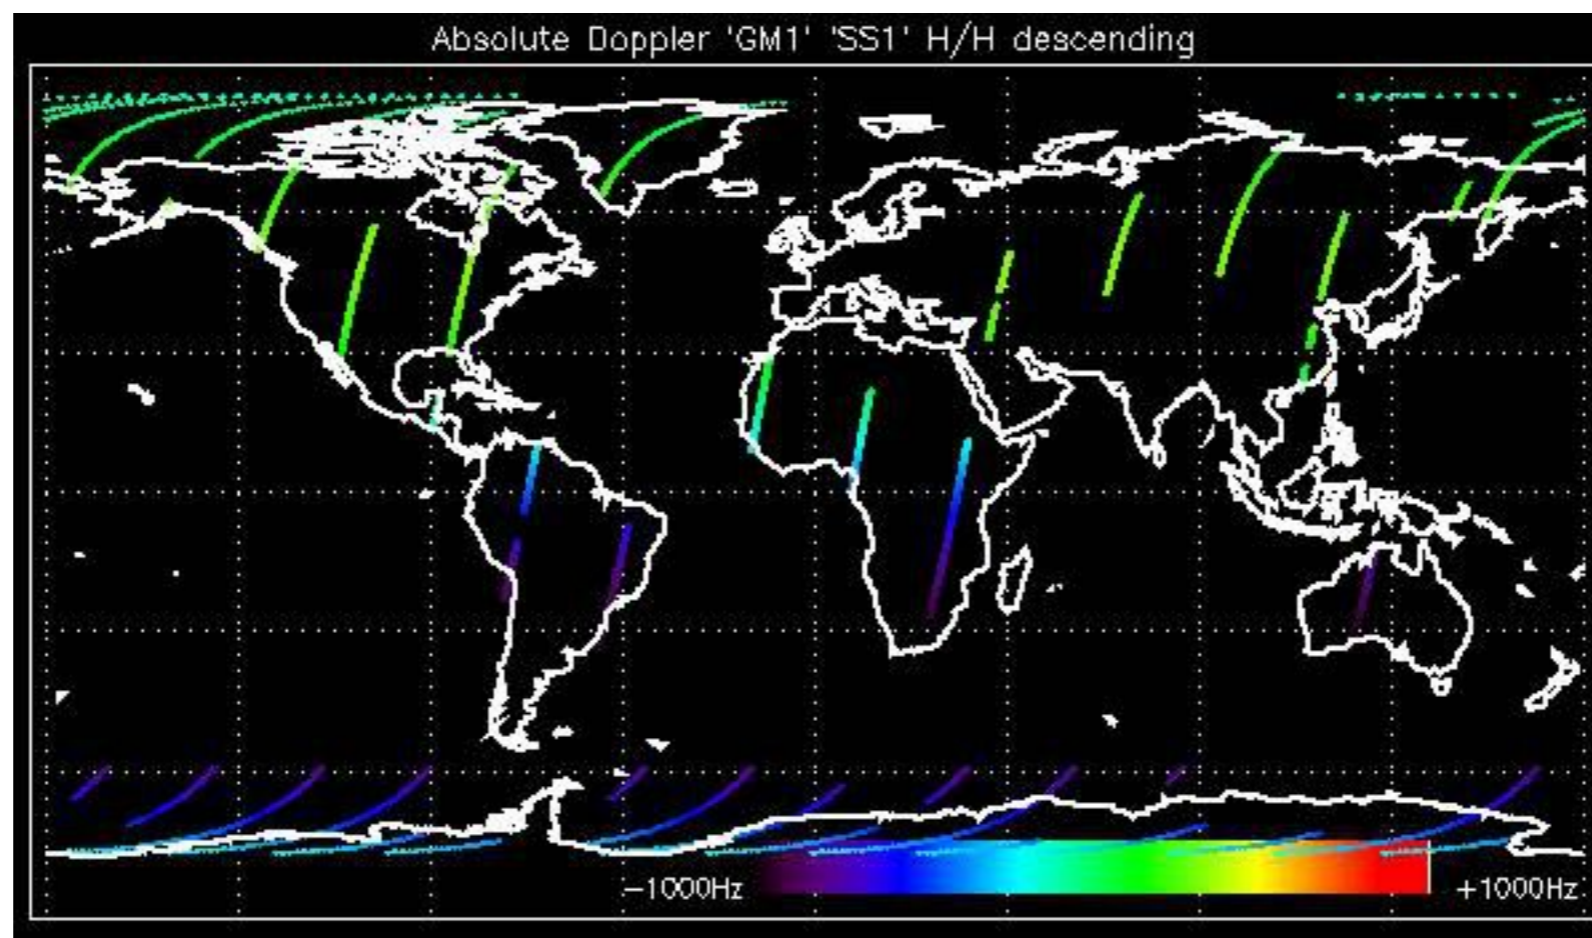


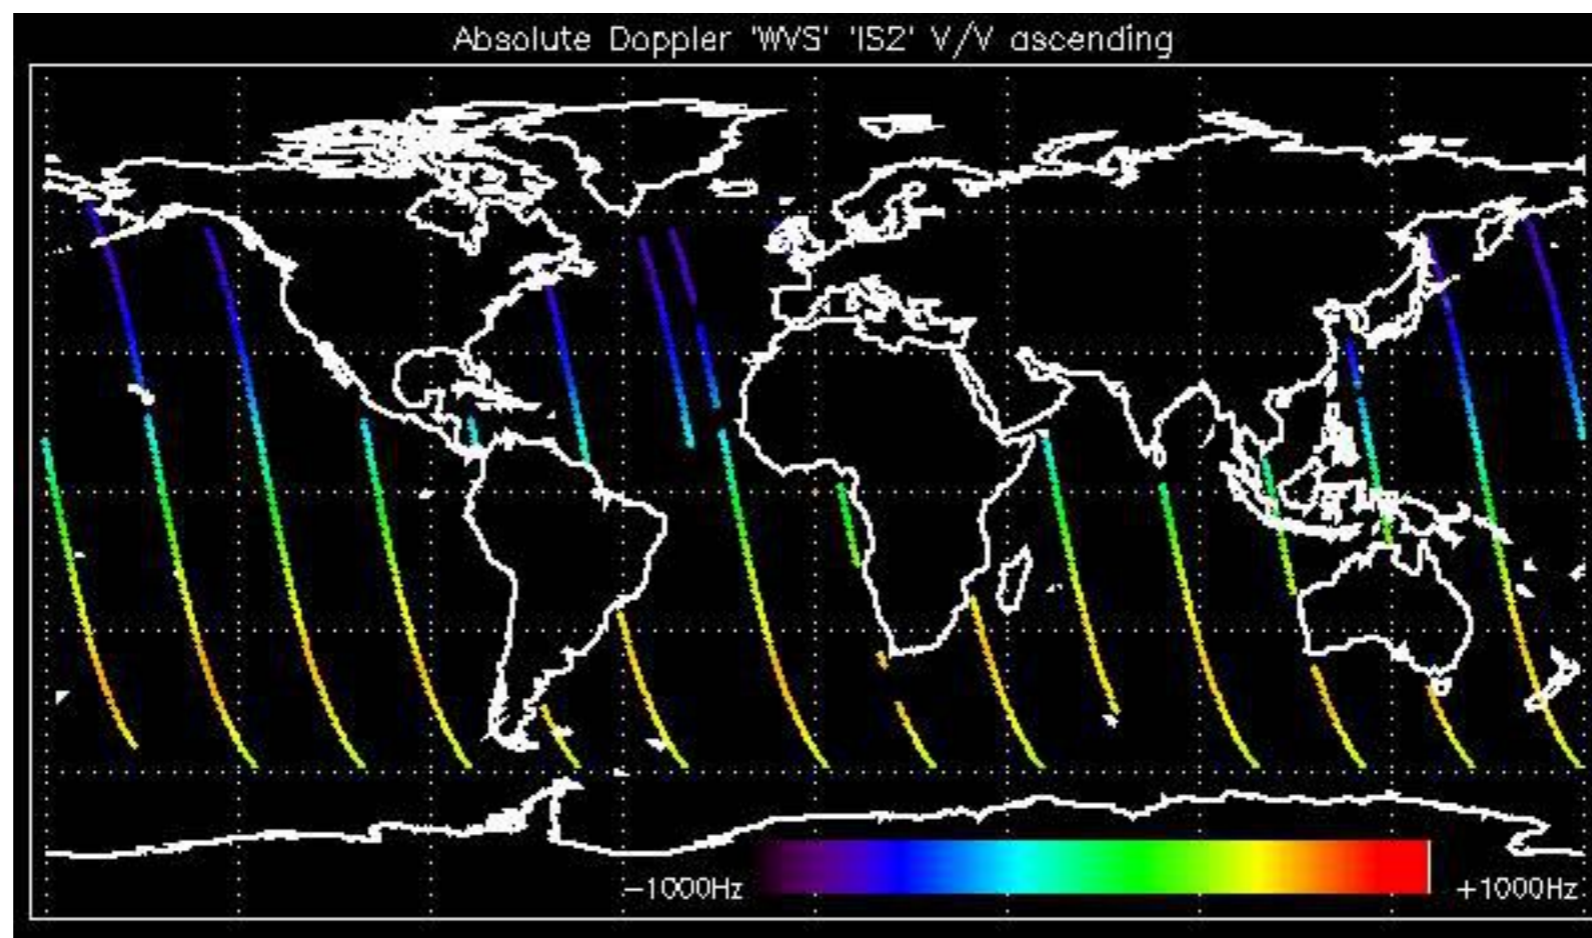


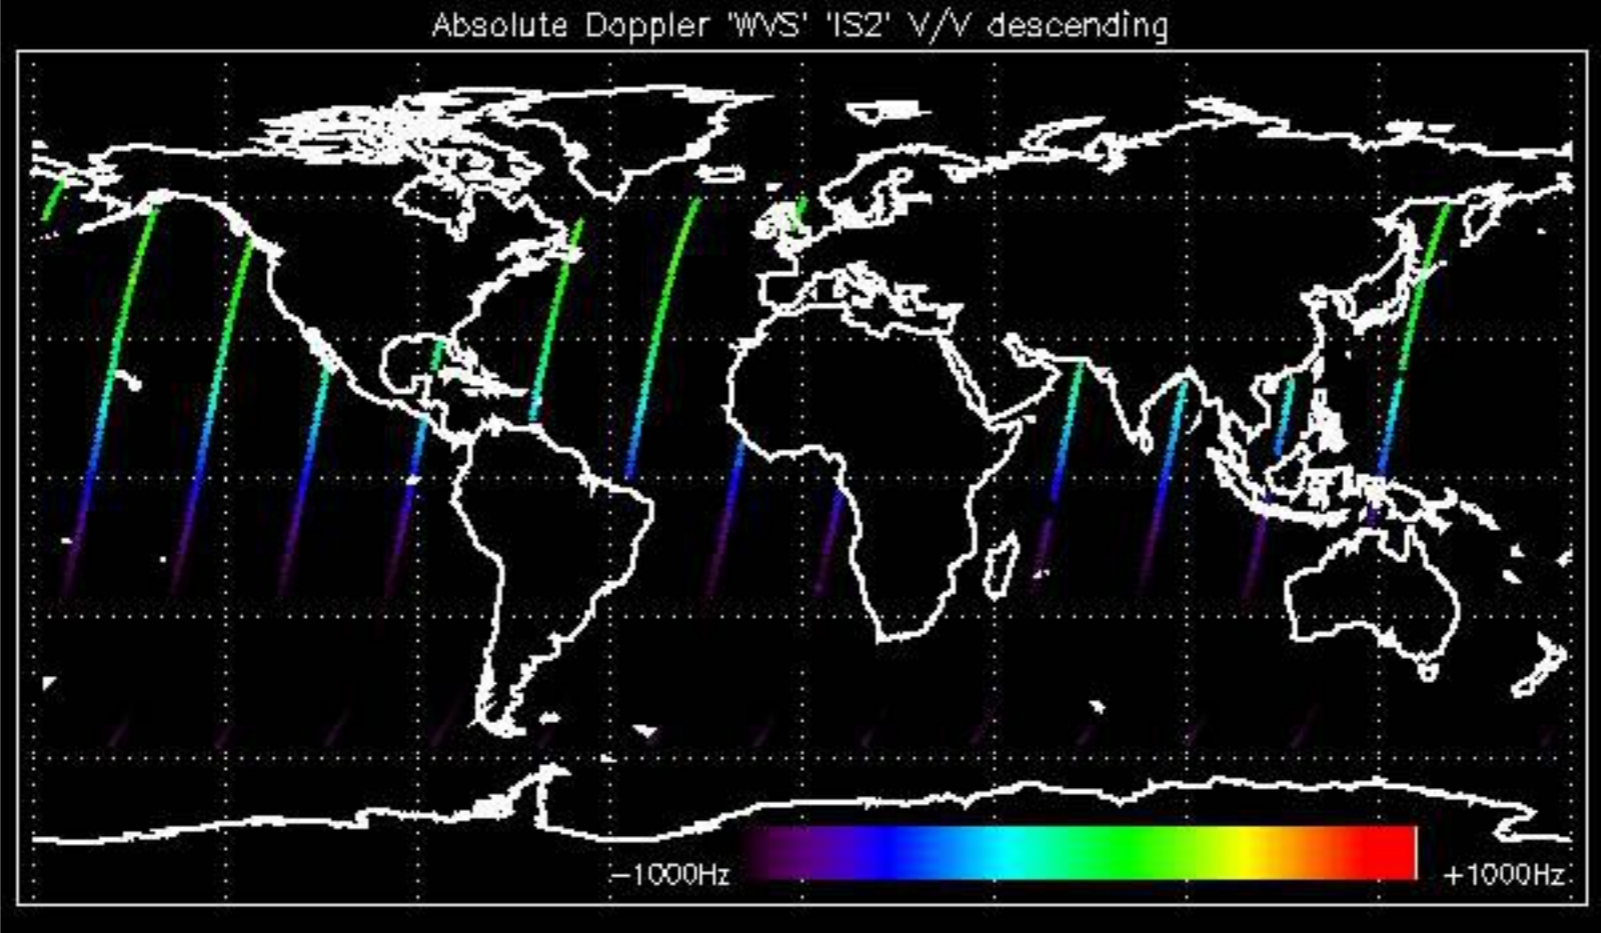


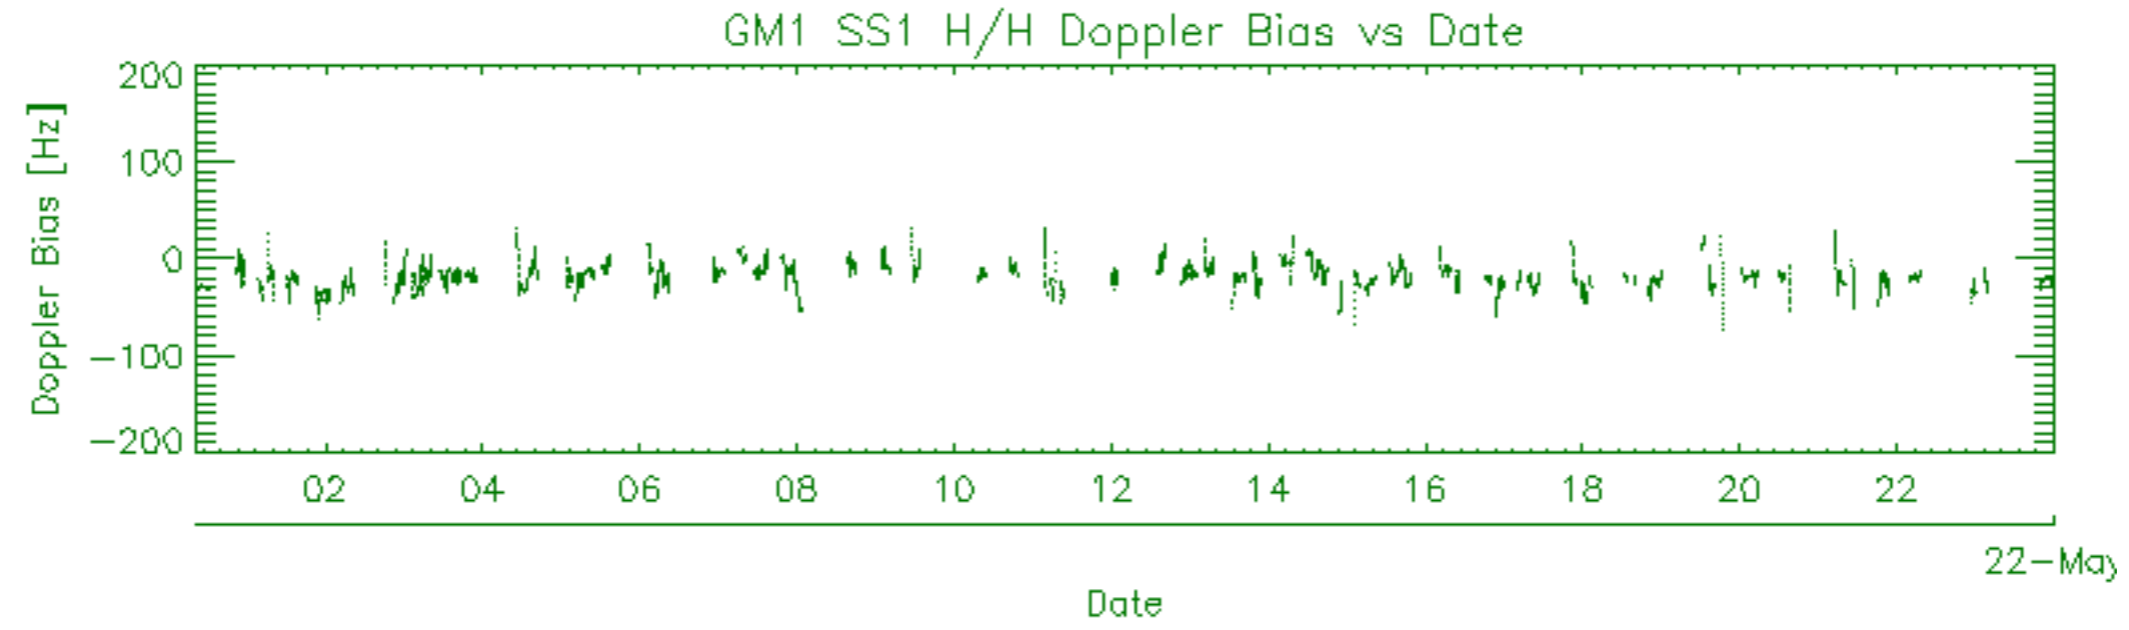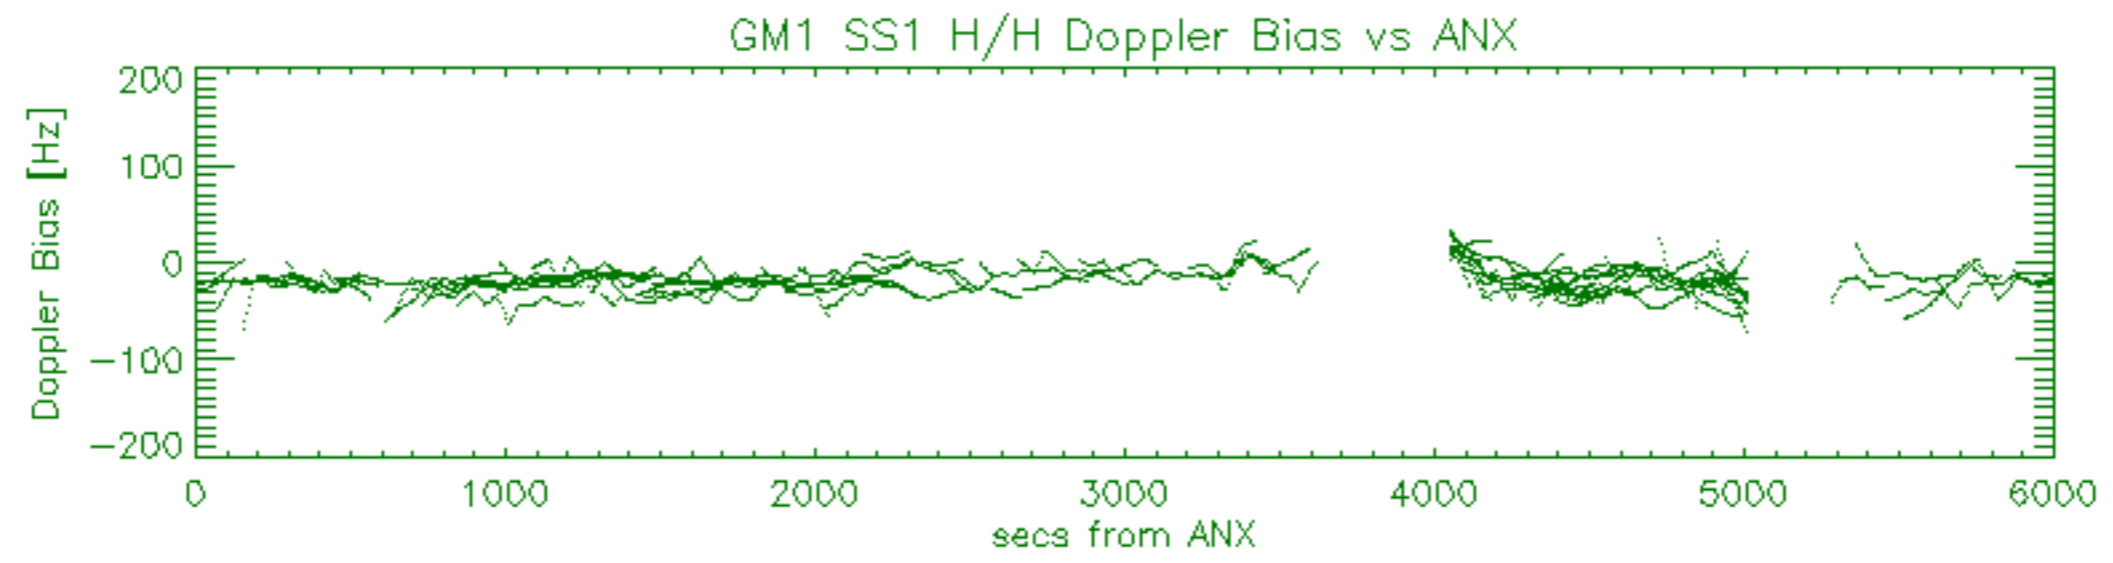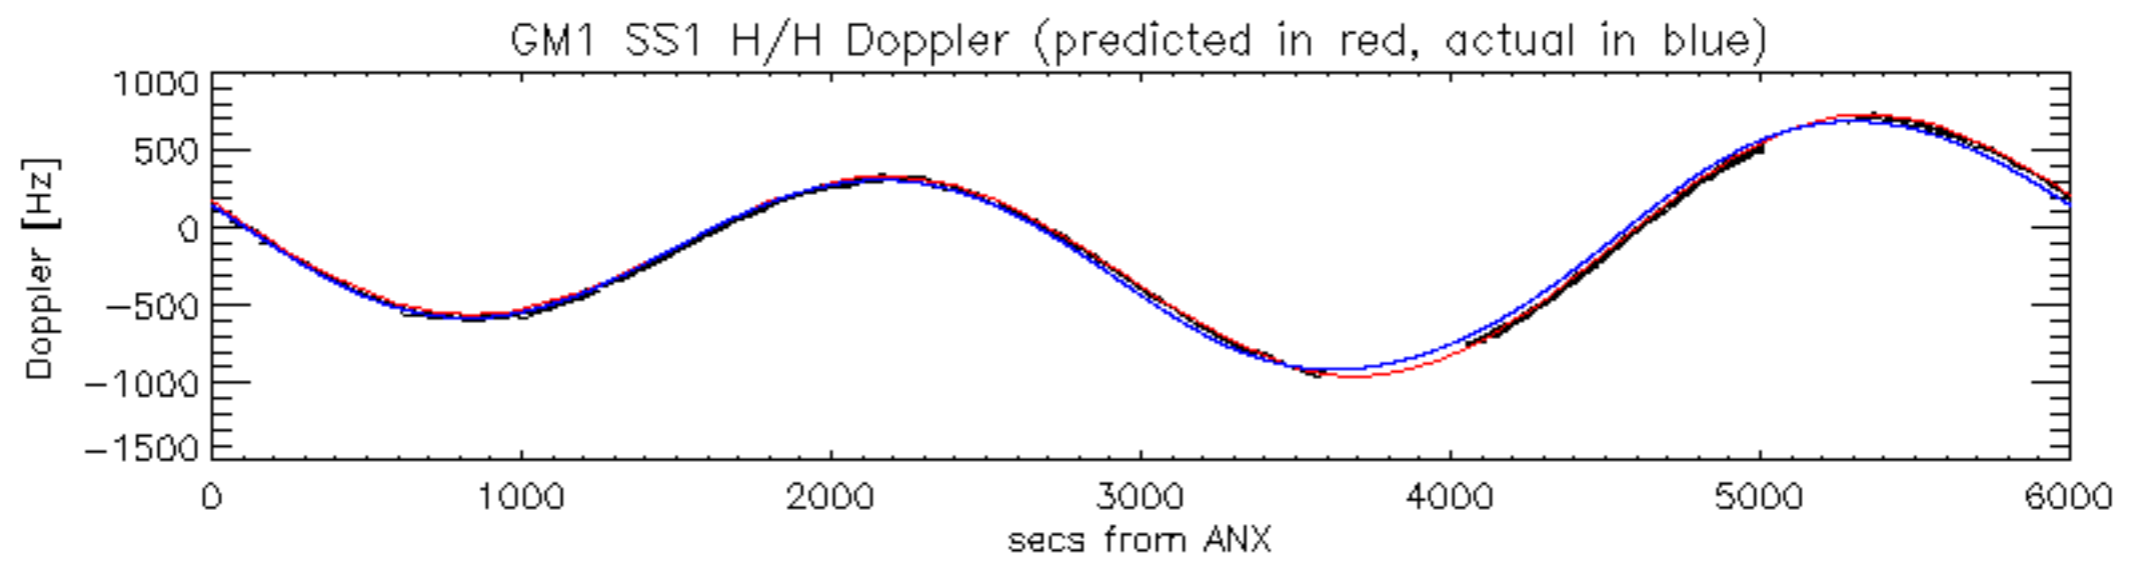



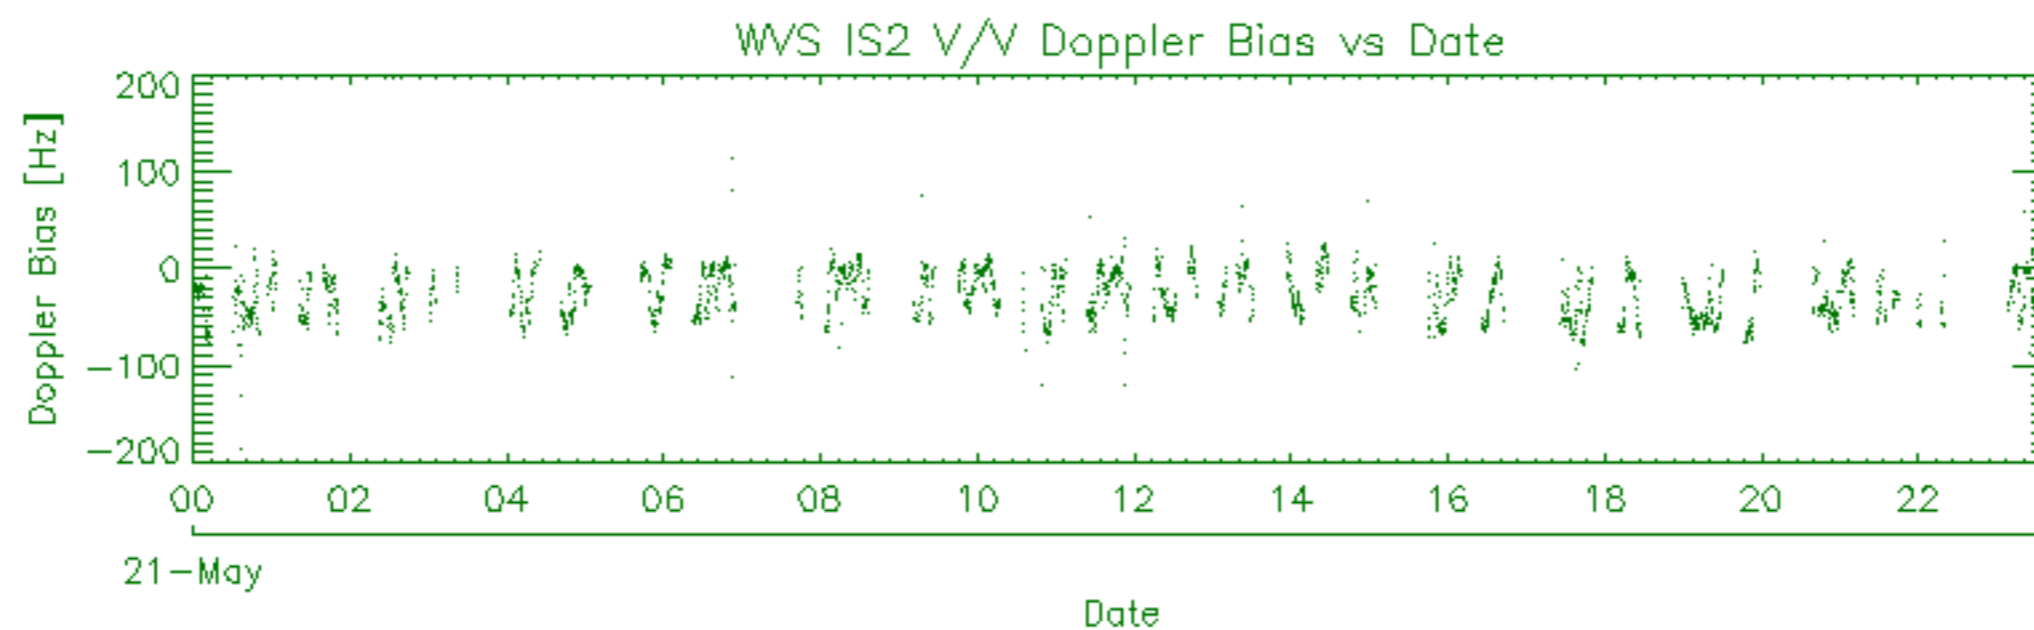
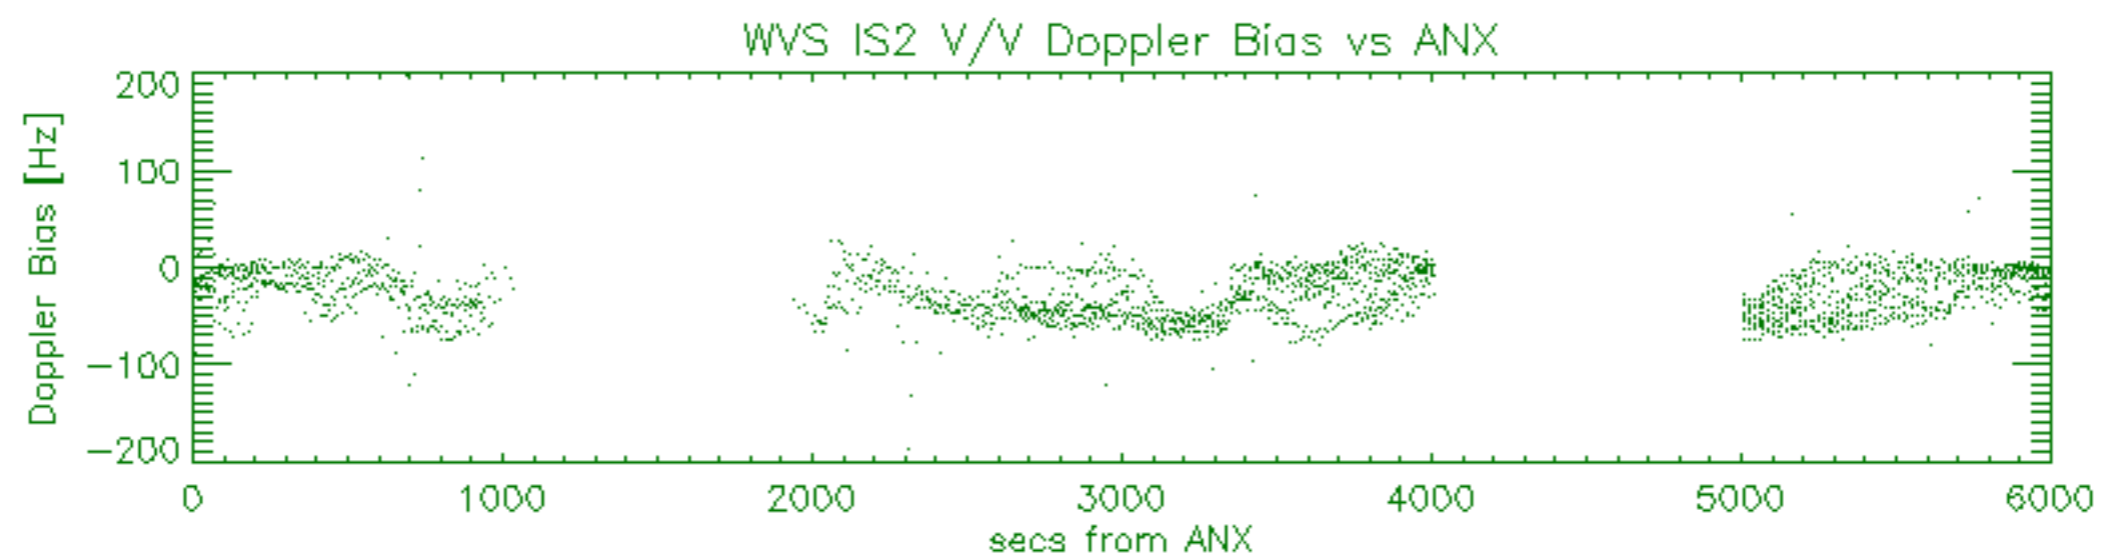
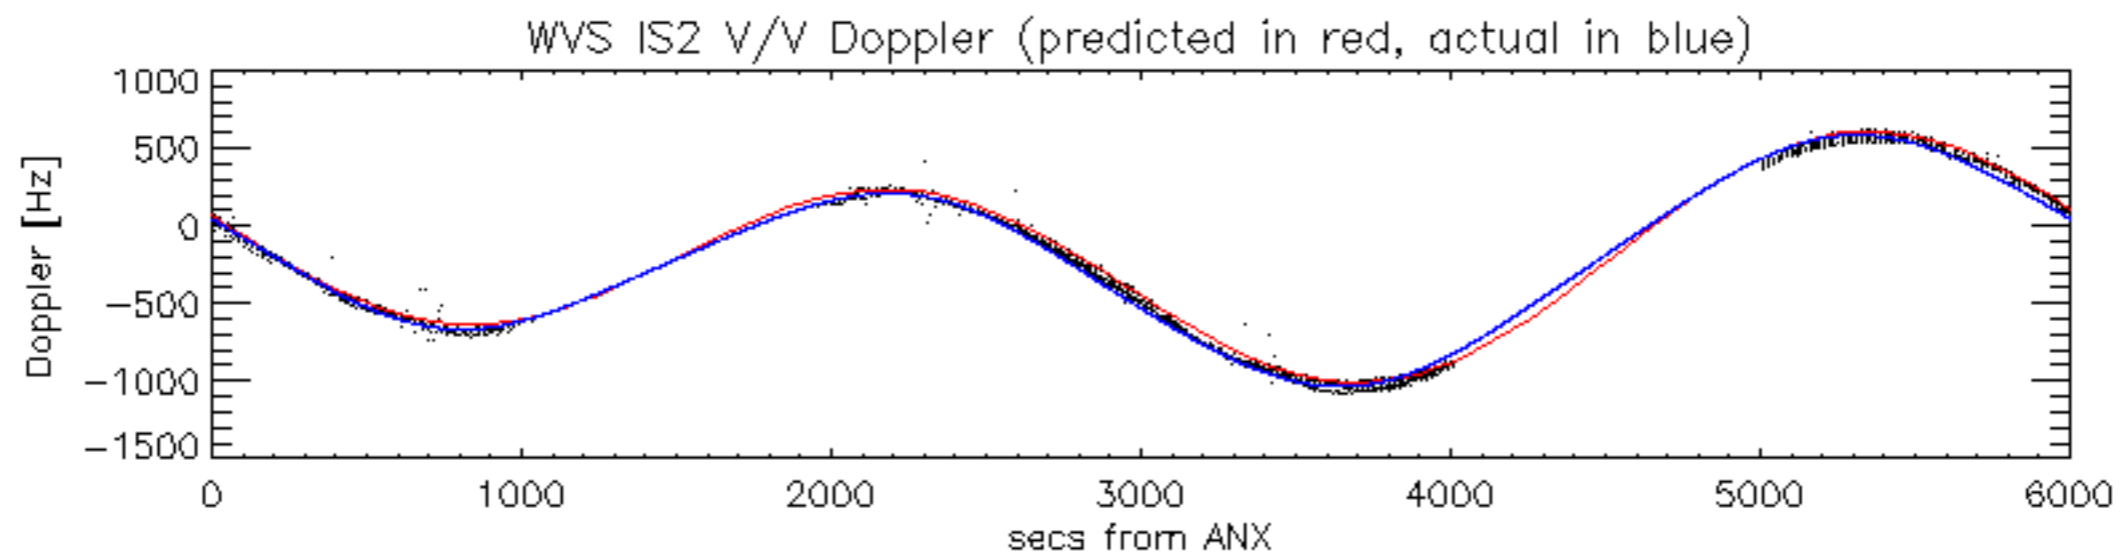


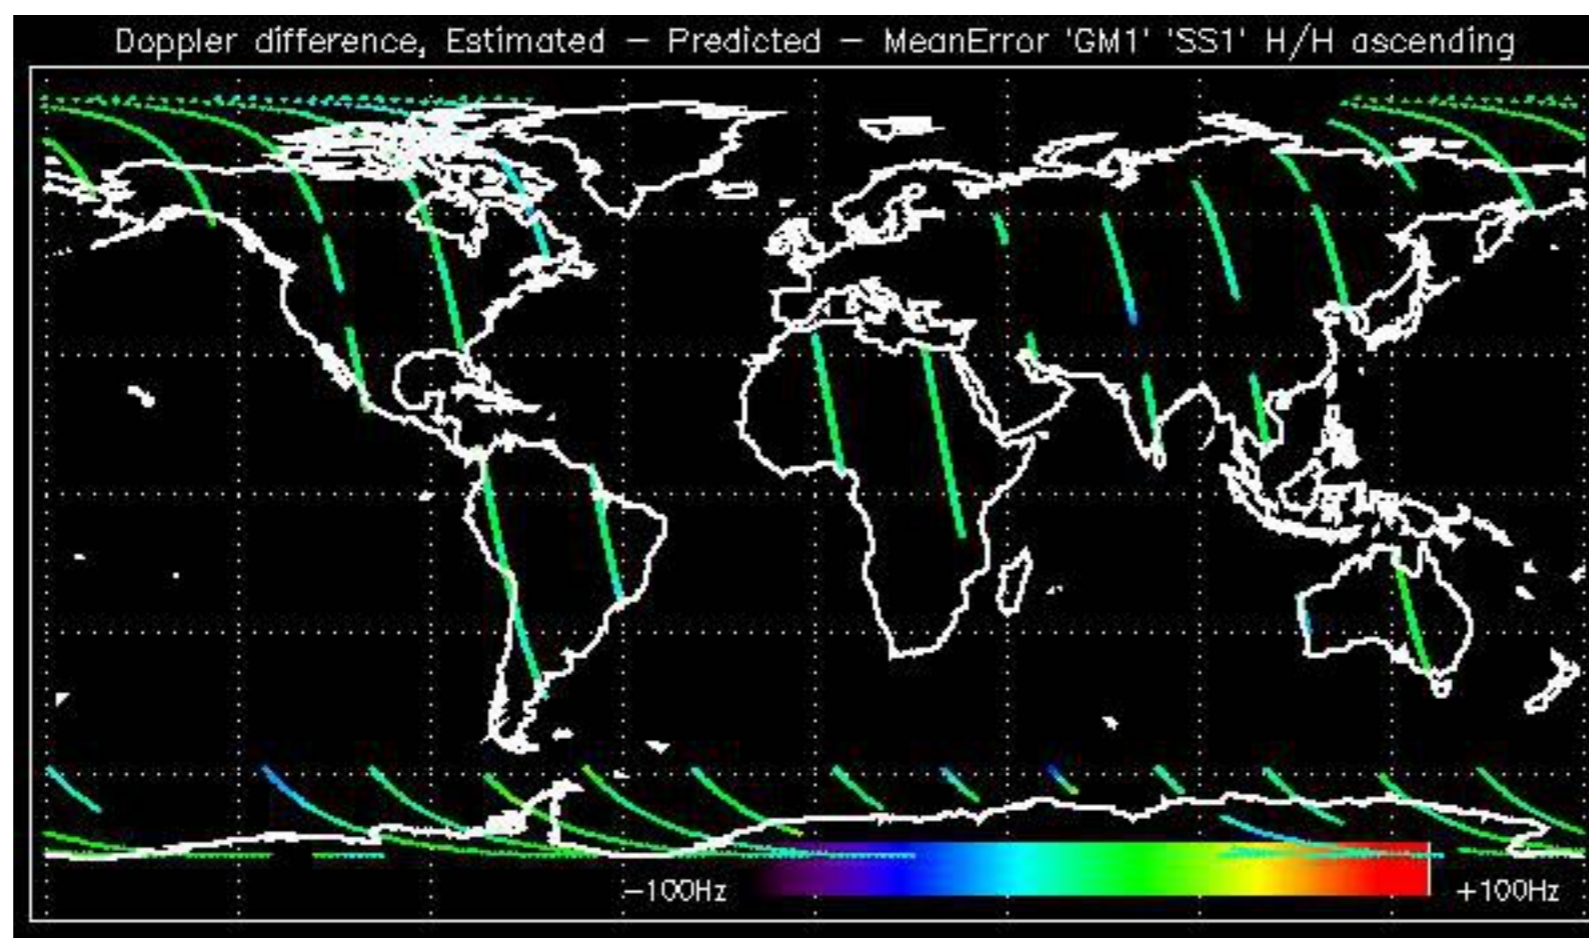


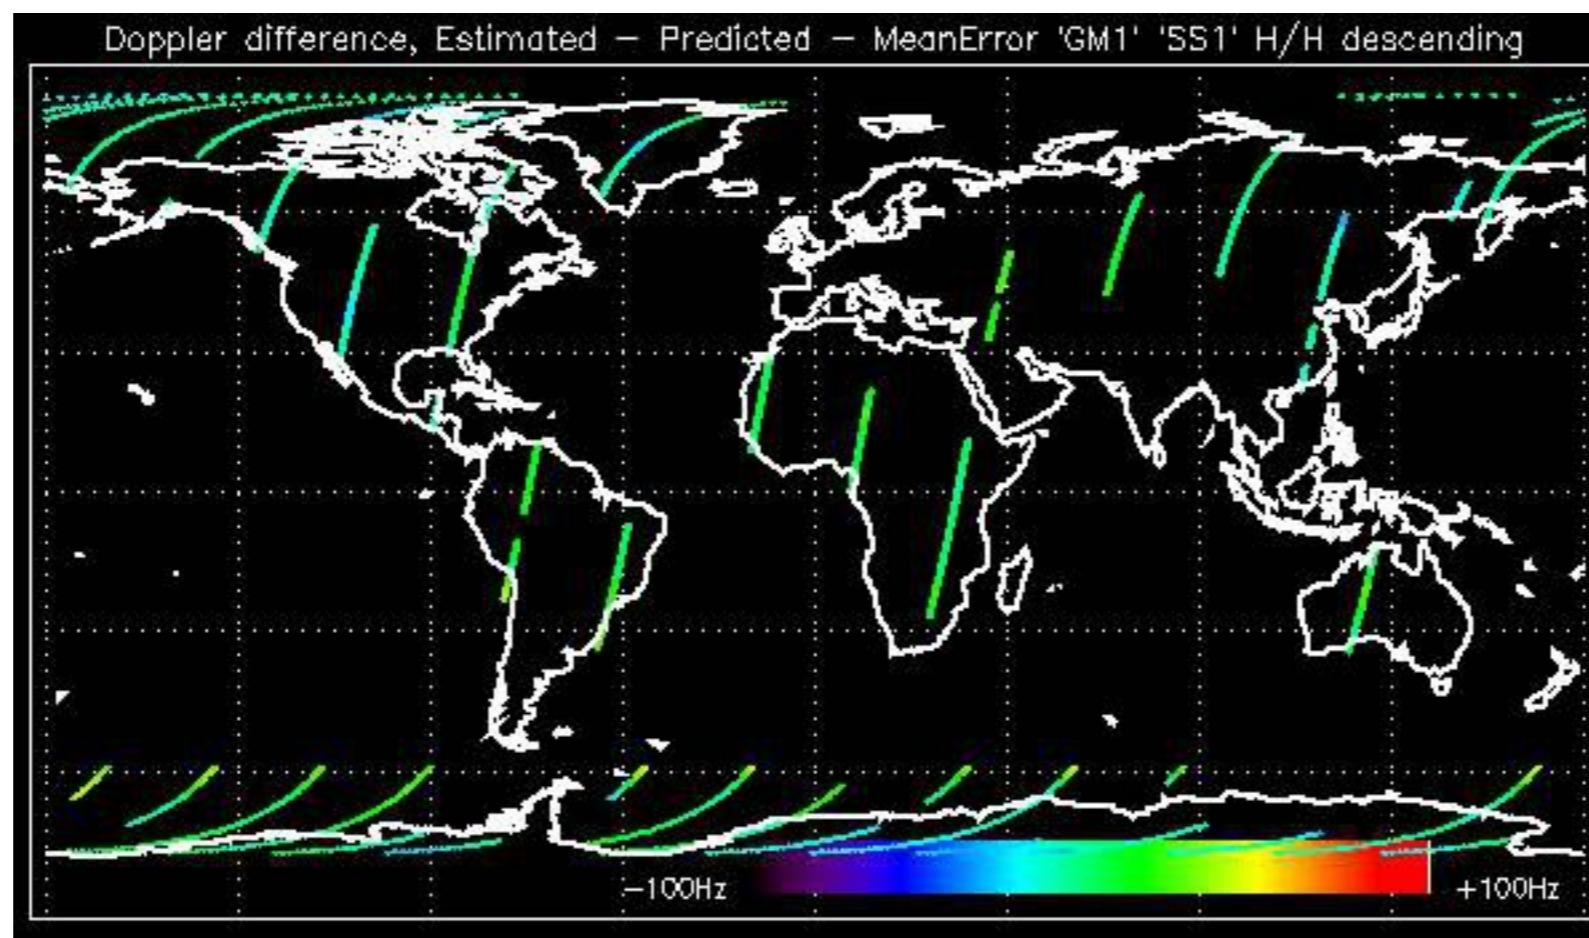


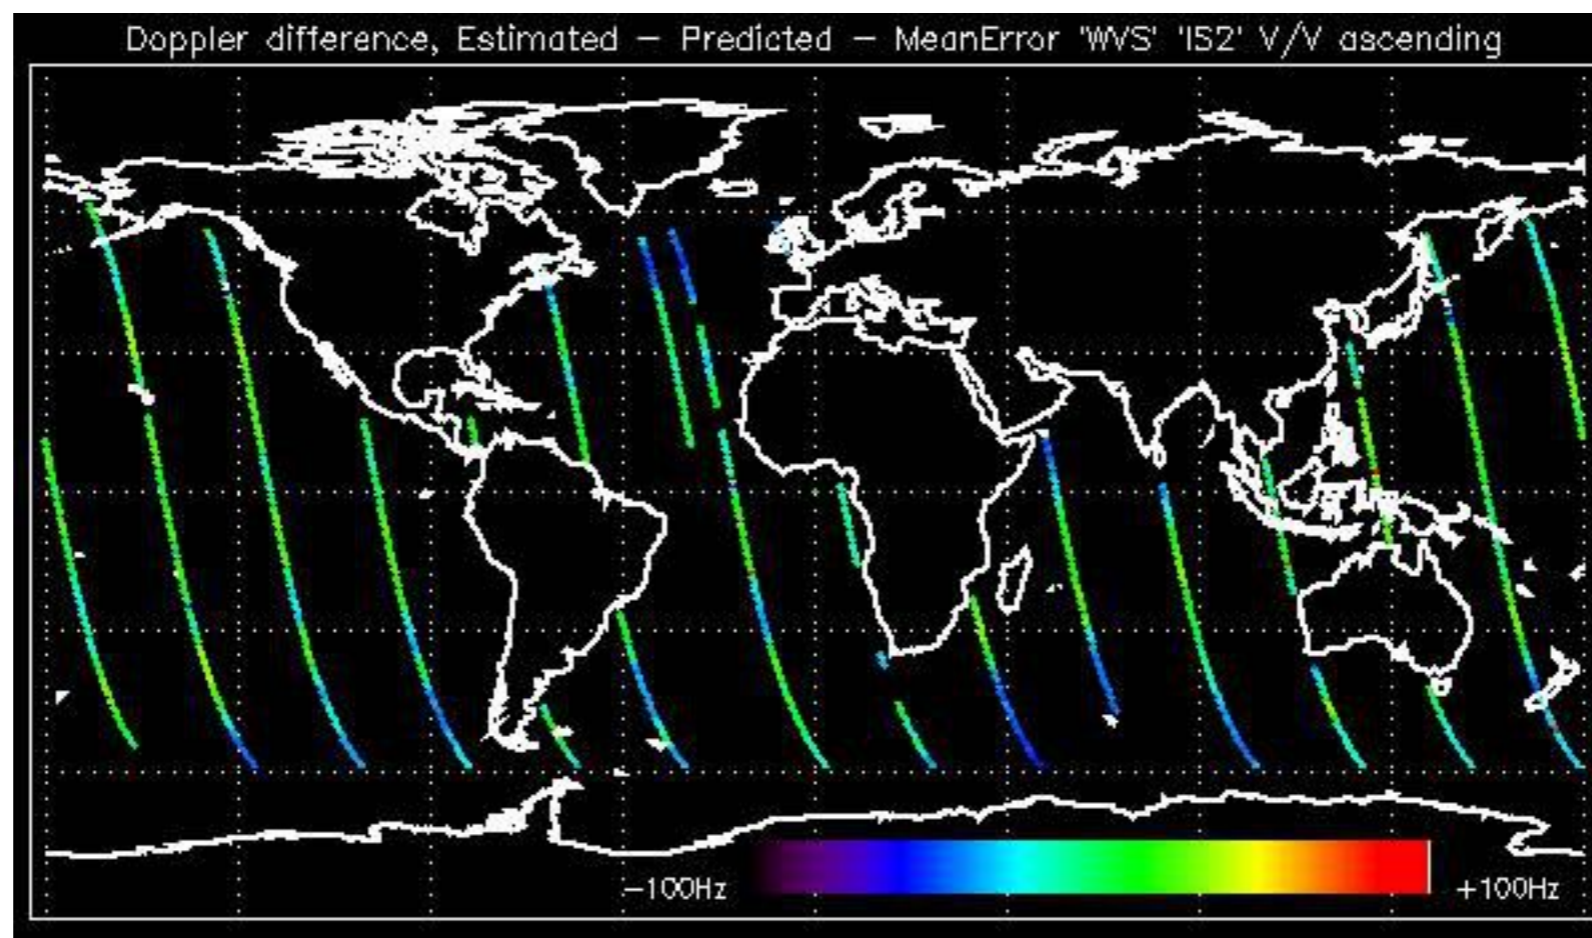


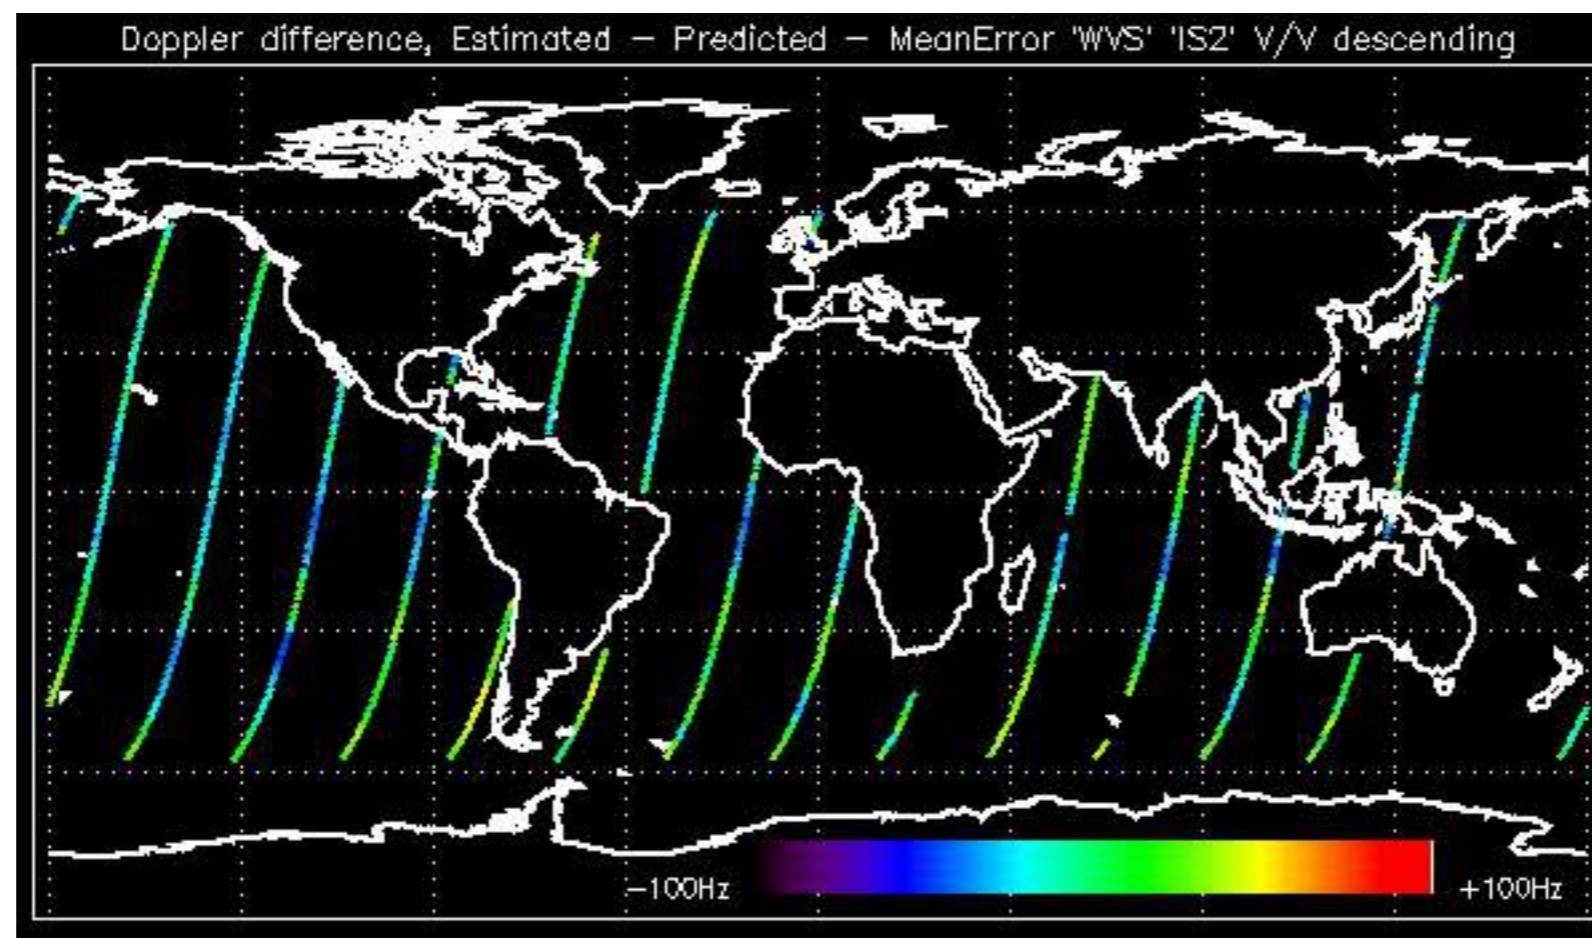

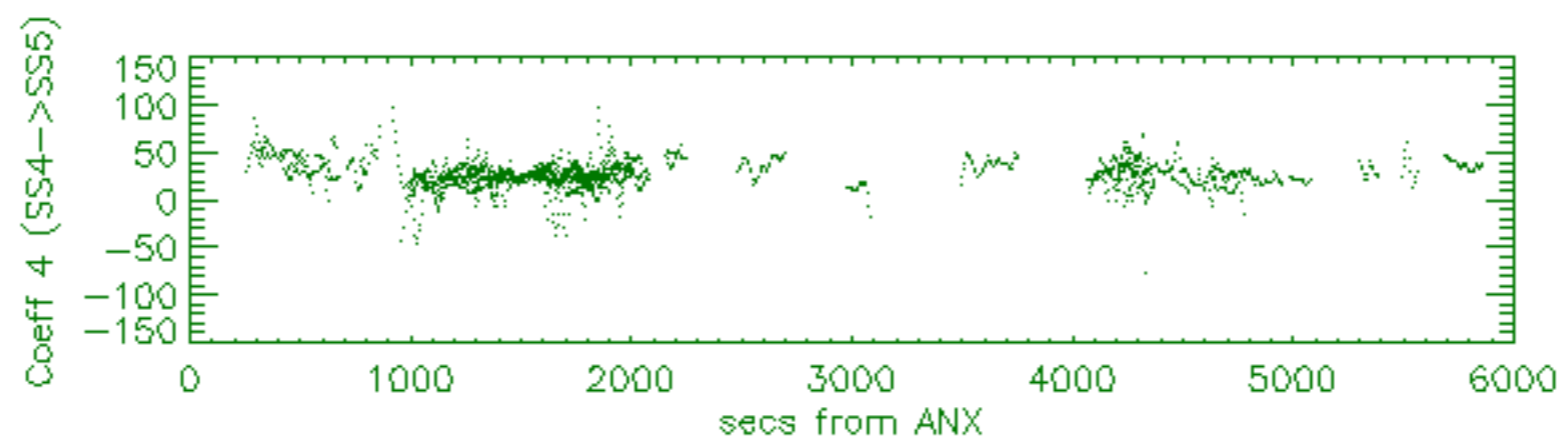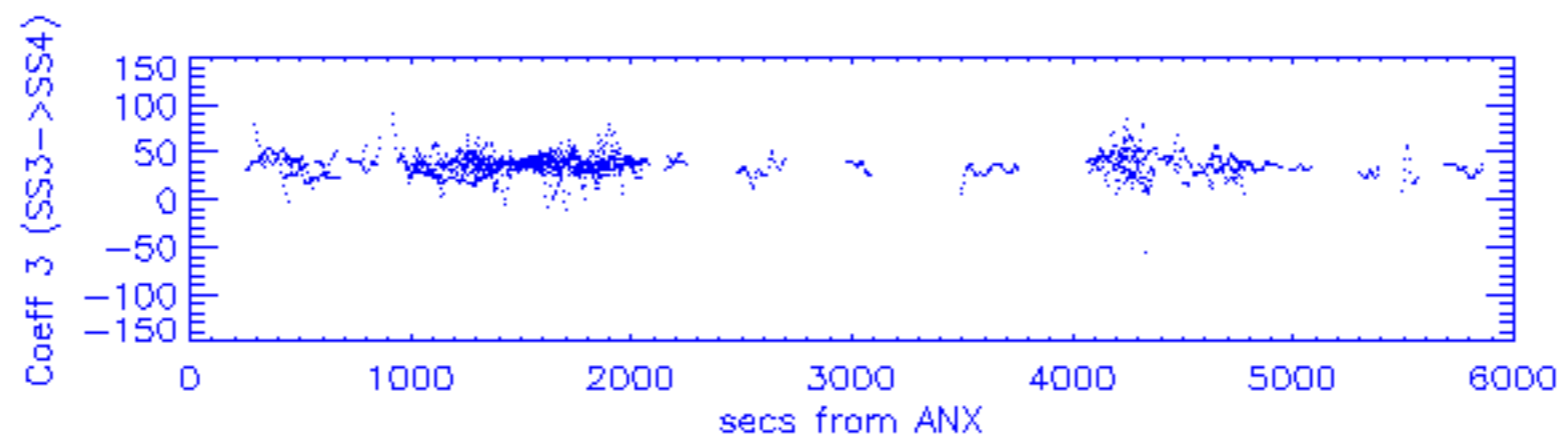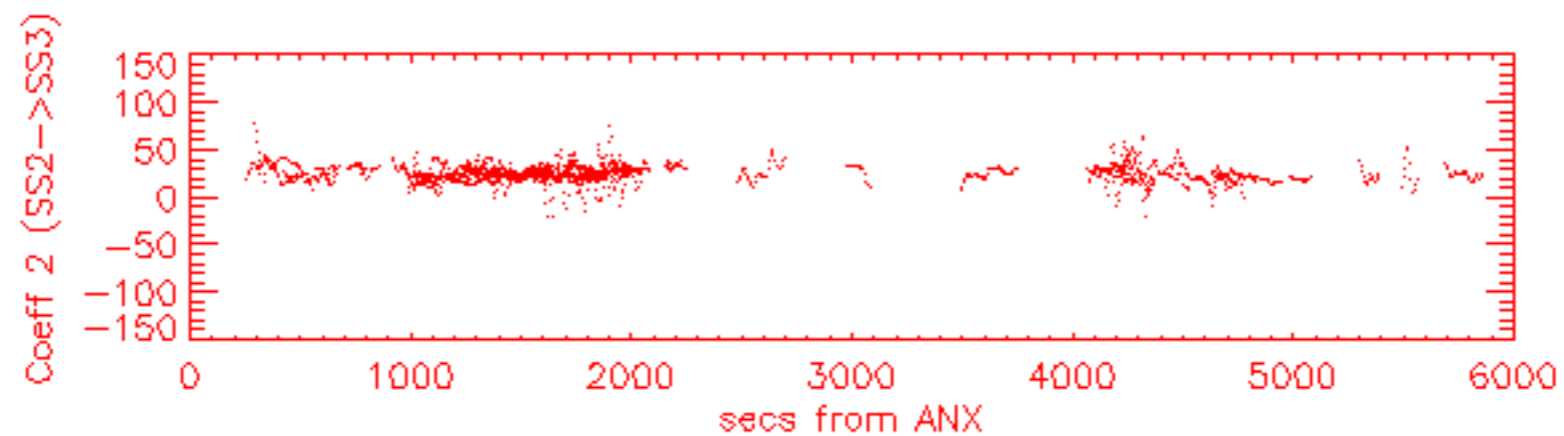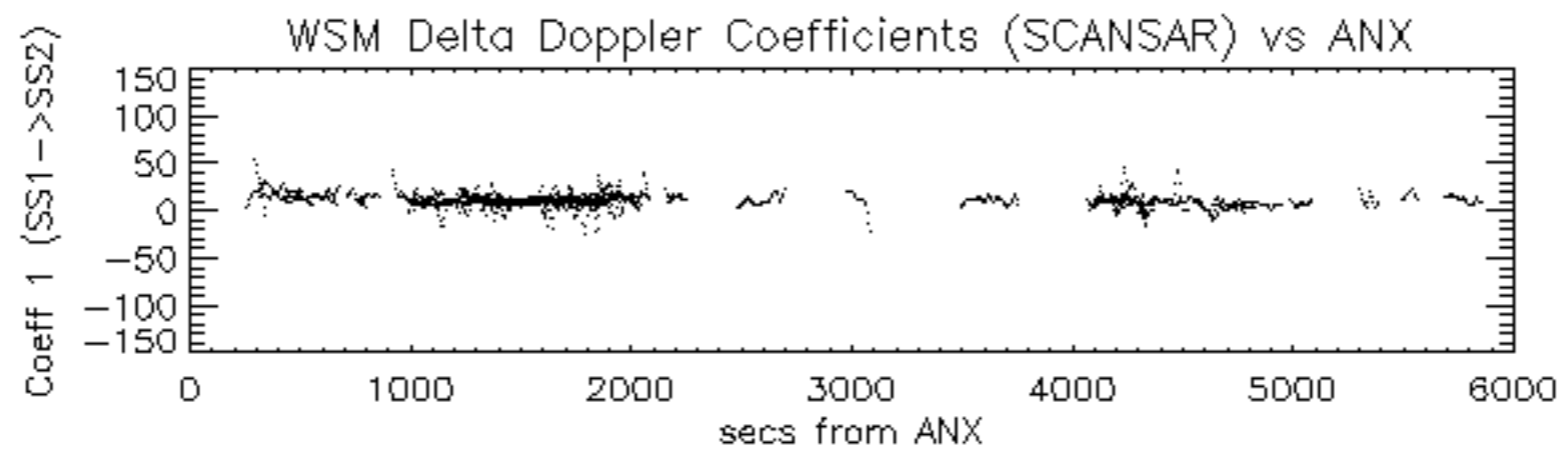


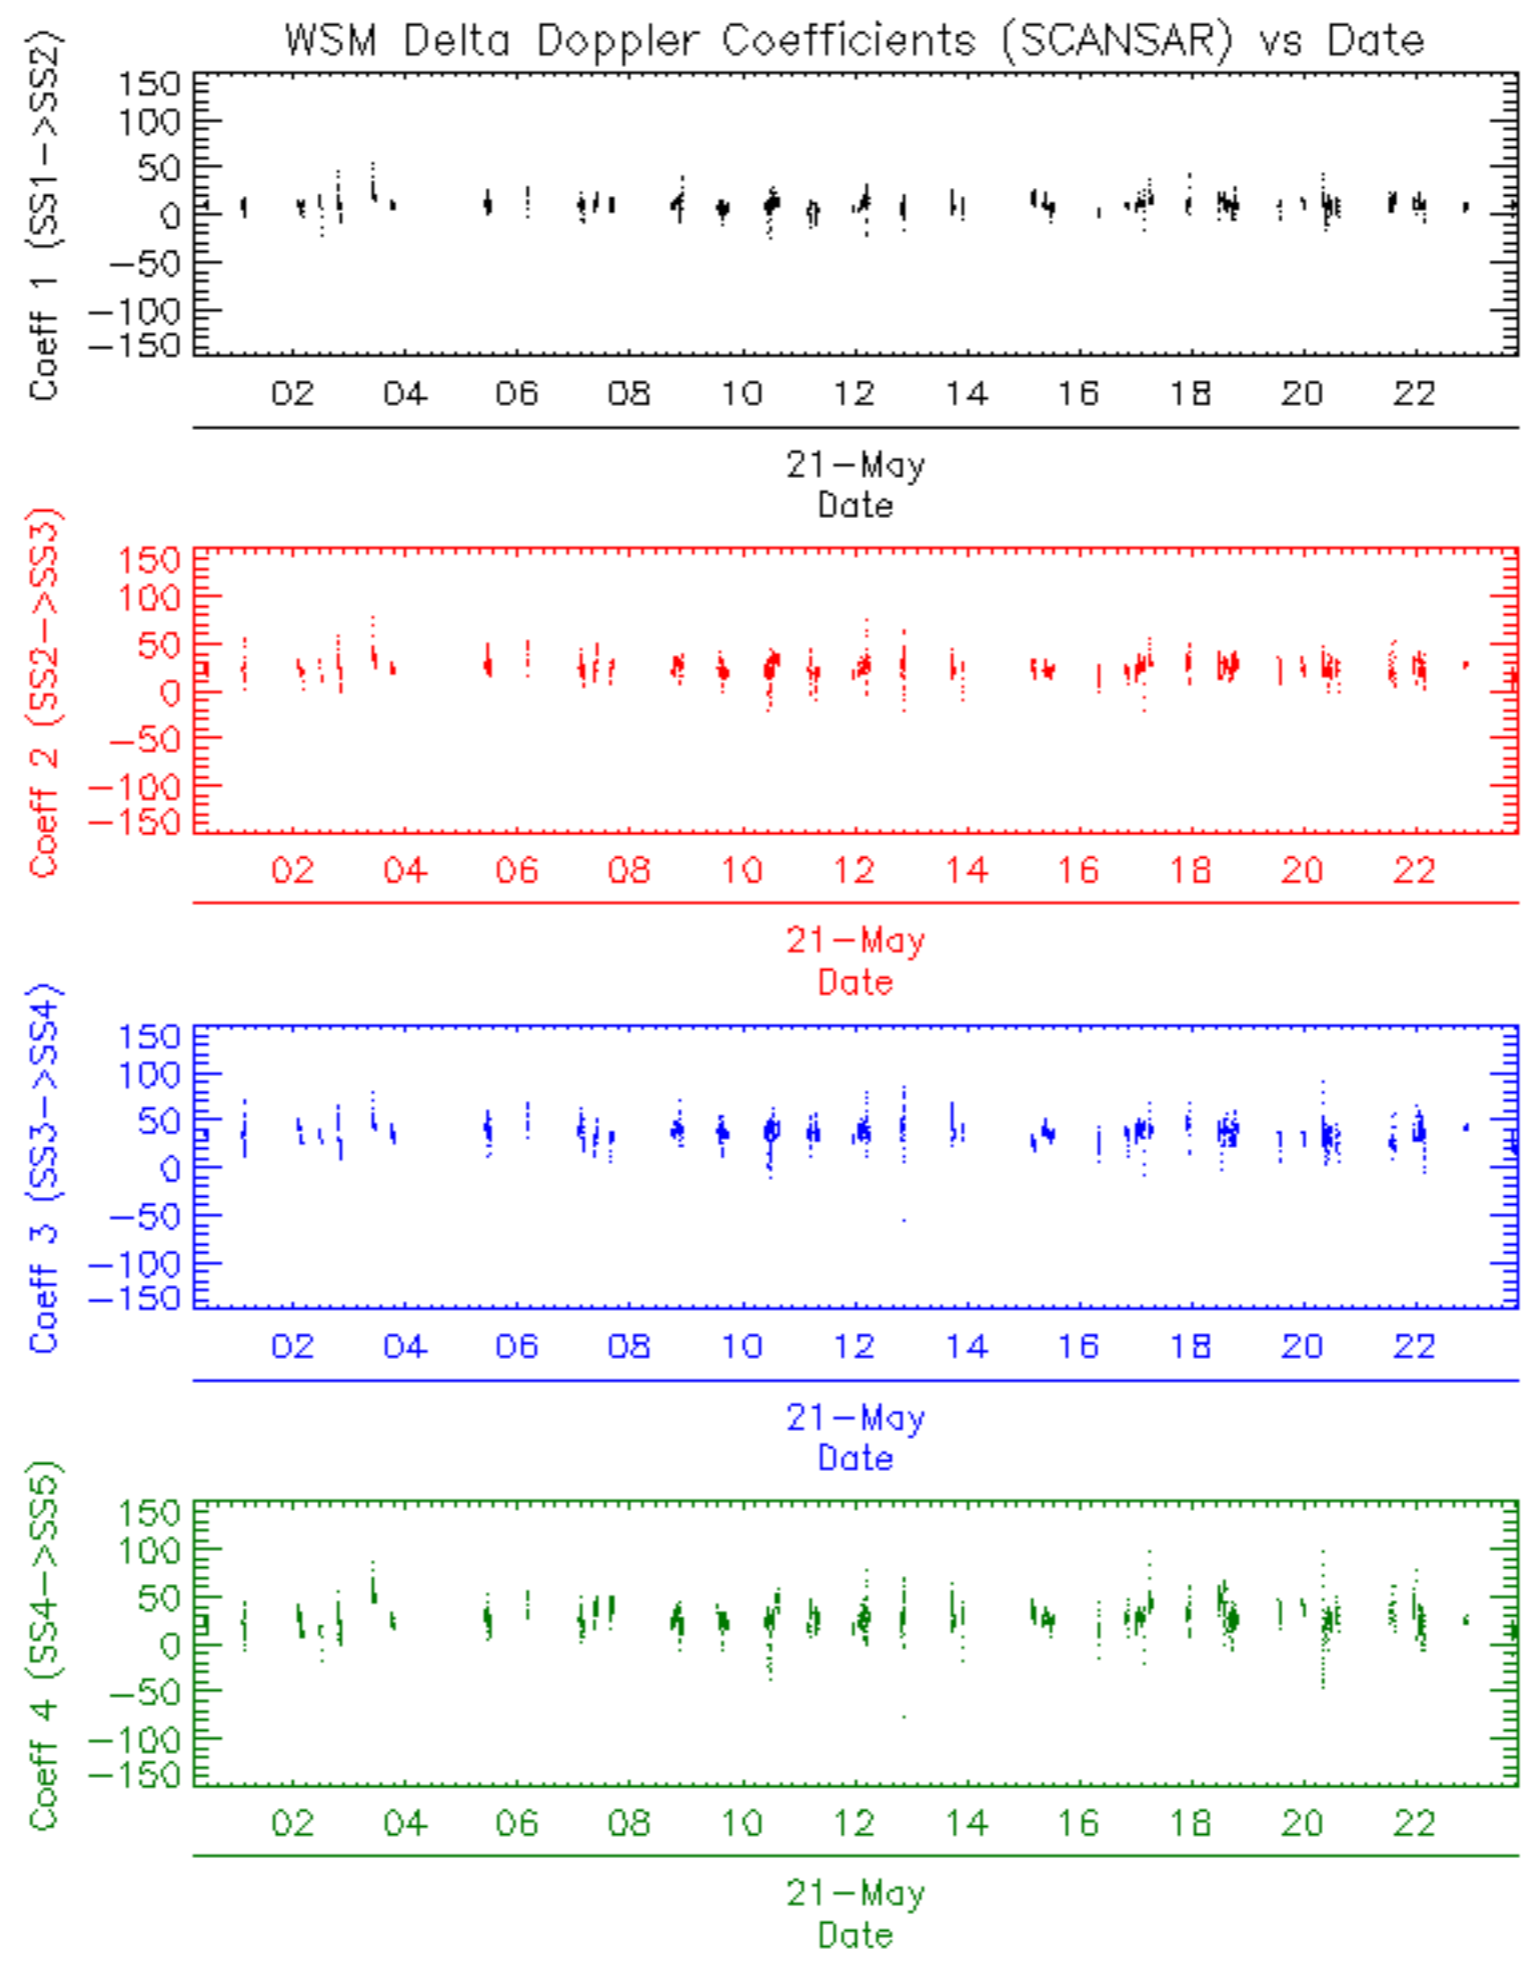

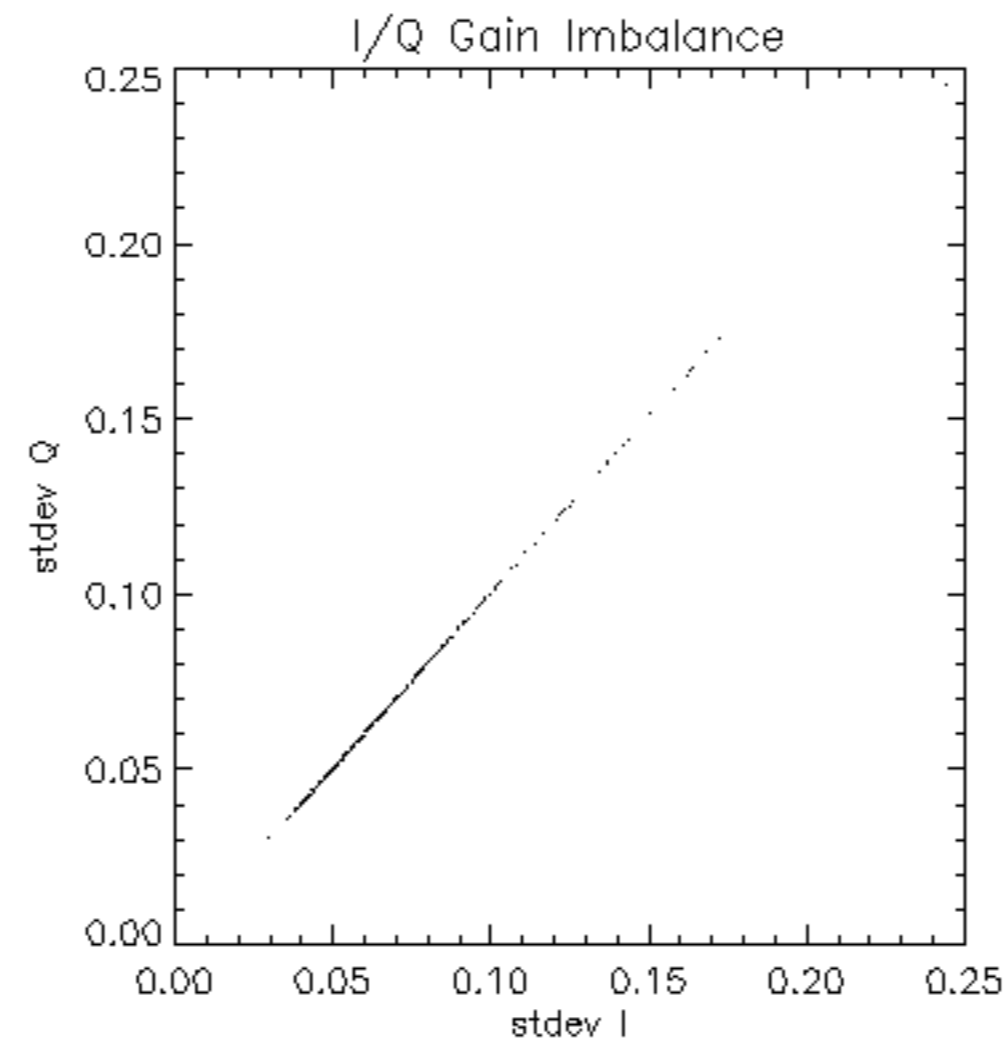


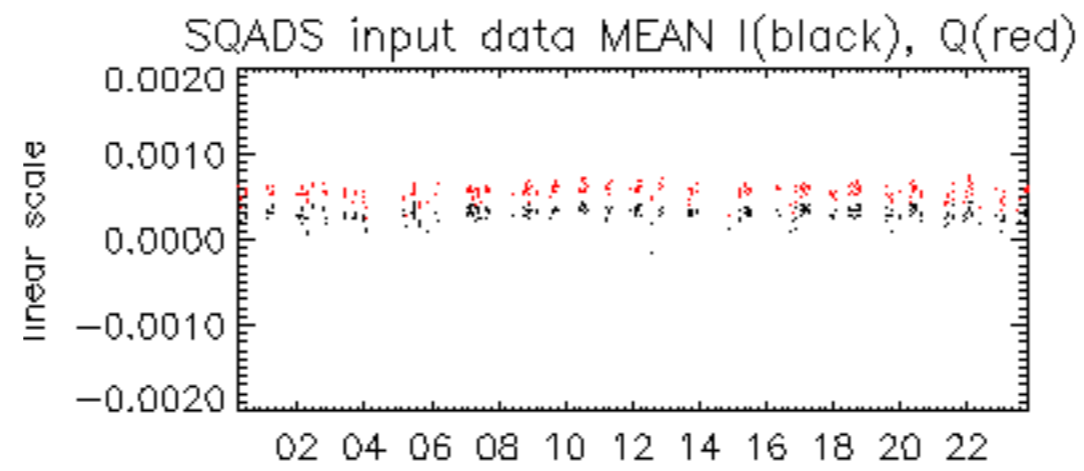


21-May

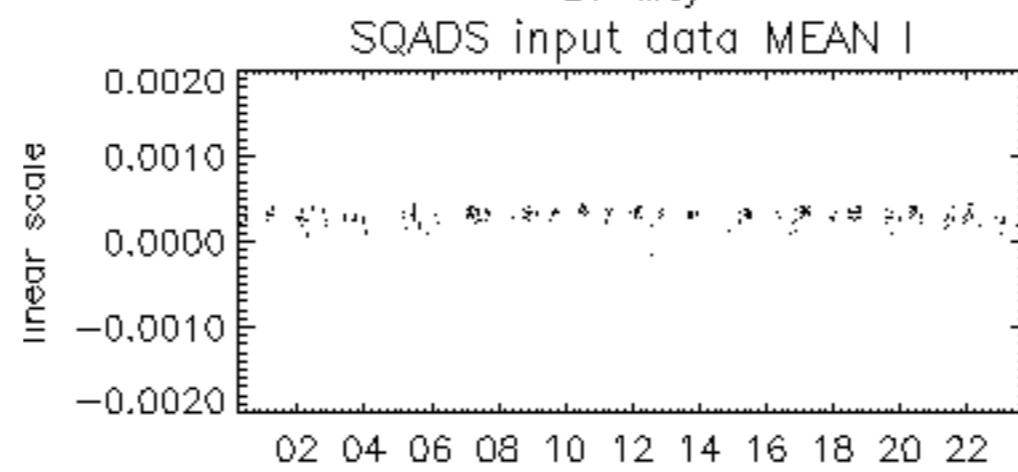


21-May

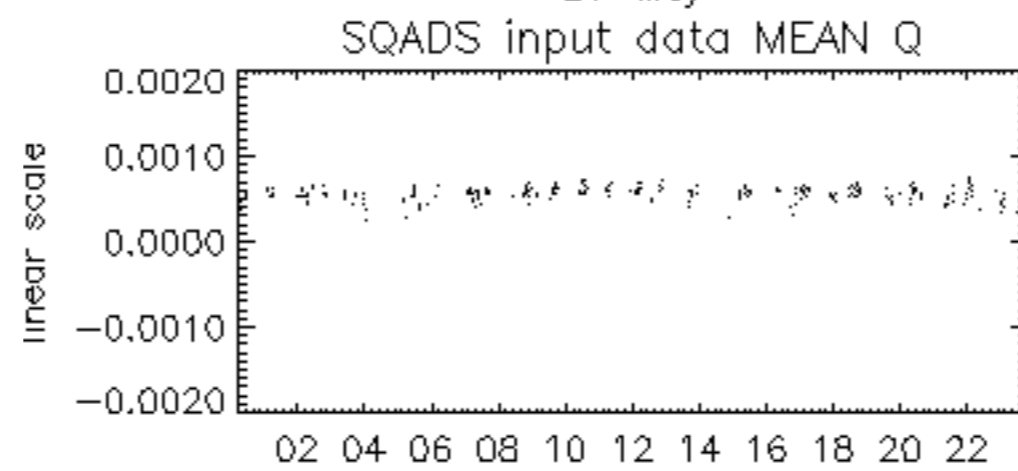


21-May

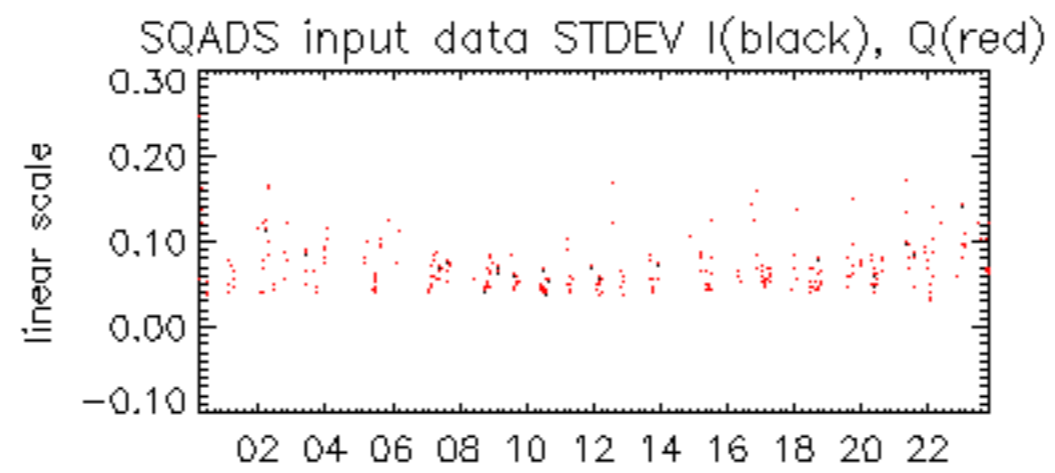

21-May

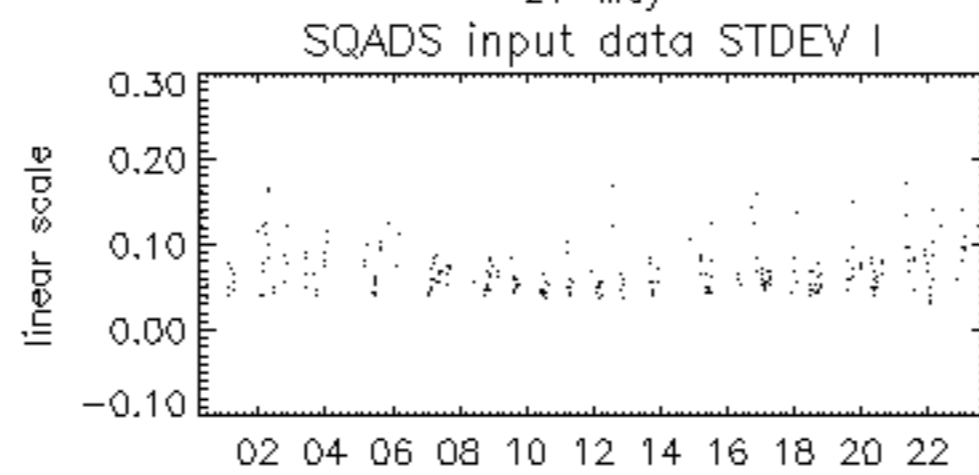

21-May

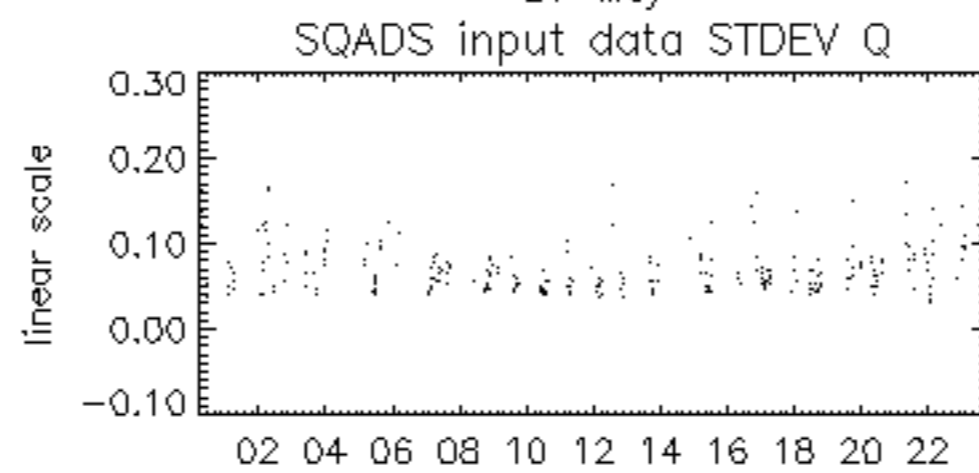

21-May

