



Analysis from 06-OCT-2009 00:00:00 to 06-OCT-2009 23:59:59. Page generated on 07-OCT-2009 07:32:23.
View log file: ASAR_Daily_Report_20091007_0731.log. For any anomalies please contact emma.griffiths@vega.co.uk.

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

SUMMARY

1. DATA SUMMARY
 - 1.1 Summary tables
 - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
 - 2.1 IECF operational ADFs list
 - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
 - 3.1 V/V polarisation
 - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
 - 4.1 Analysis for WVS IS2 V/V
 - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
 - 4.1.2 All Rows Analysis for WVS IS2 V/V
 - 4.2 Analysis for GM1 SS3 H/H
 - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
 - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
 - 5.1 Analysis for WVS IS2 V/V
 - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
 - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
 - 5.2 Analysis for GM1 SS1 H/H
 - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
 - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
 - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
 - 6.1 Analysis for WSM SS1 H/H
 - 6.1.1 ScaleFactor
 - 6.2 Analysis for WSM SS1 V/V
 - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
 - 7.1 Analysis for WVS
 - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
 - 8.1 Number of Missing Lines
 - 8.2 Number of Gaps

1 - DATA SUMMARY

1.1 - Summary tables

[[BACK TO MENU](#)]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	1	PDE	WS	H/H	40	PDE	IS2	***	1	PDE	IS2	***	1	PDE	WS	H/H	55	PDK	2009-10-06 08:50:17	V	320
PDE	IS2	V/V	30	PDK	WS	H/H	40	PDE	IS2	H/H	1	PDE	IS2	H/H	2	PDE	WS	V/V	7				
PDK	IS2	V/V	19					PDE	IS4	H/H	1	PDE	IS2	V/V	10	PDK	WS	H/H	15				
												PDE	IS3	H/H	2	PDK	WS	V/V	4				
												PDE	IS3	V/V	1								
												PDE	IS5	V/V	1								
												PDE	IS6	***	1								
												PDE	IS6	V/V	2								
												PDE	IS7	H/H	1								
												PDK	IS2	H/H	3								
												PDK	IS2	V/V	2								

1.2 - Lists of products used

[[BACK TO MENU](#)]

[\[TXT\] \[XLS\] List_WVS_products_used](#)
[\[TXT\] \[XLS\] List_GM1_products_used](#)
[\[TXT\] \[XLS\] List_APM_products_used](#)
[\[TXT\] \[XLS\] List_IMM_products_used](#)
[\[TXT\] \[XLS\] List_WSM_products_used](#)
[\[TXT\] \[XLS\] List_MS_products_used](#)

2 - AUXILIARY FILES ANALYSIS

2.1 - IECF operational ADFs list

[[BACK TO MENU](#)]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20081215_141339_20070204_165113_20091231_000000
ASA_INS_AXVIEC20090525_114808_20090428_100000_20091231_235959
ASA_XCH_AXVIEC20081215_143642_20020301_000000_20091231_000000
ASA_XCA_AXVIEC20090311_104501_20080801_000000_20091231_235959

2.2 - Products with wrong ADFs

[[BACK TO MENU](#)]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0

- [TXT] [XLS] Check_ADFs_WVS
- [TXT] [XLS] Check_ADFs_GM1
- [TXT] [XLS] Check_ADFs_APM
- [TXT] [XLS] Check_ADFs_IMM
- [TXT] [XLS] Check_ADFs_WSM

3 - MODULE STEPPING PRODUCTS ANALYSIS





3.2 - H/H polarisation


[[BACK TO MENU](#)]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
After antenna maintenance (2005-09-22/23)	Previous product in the same polarisation

Reference: 2005-09-22 06:26:51 H RxGain
 Test : 2009-10-05 09:21:54 H



Reference: 2009-10-03 08:44:32 H RxGain
 Test : 2009-10-05 09:21:54 H


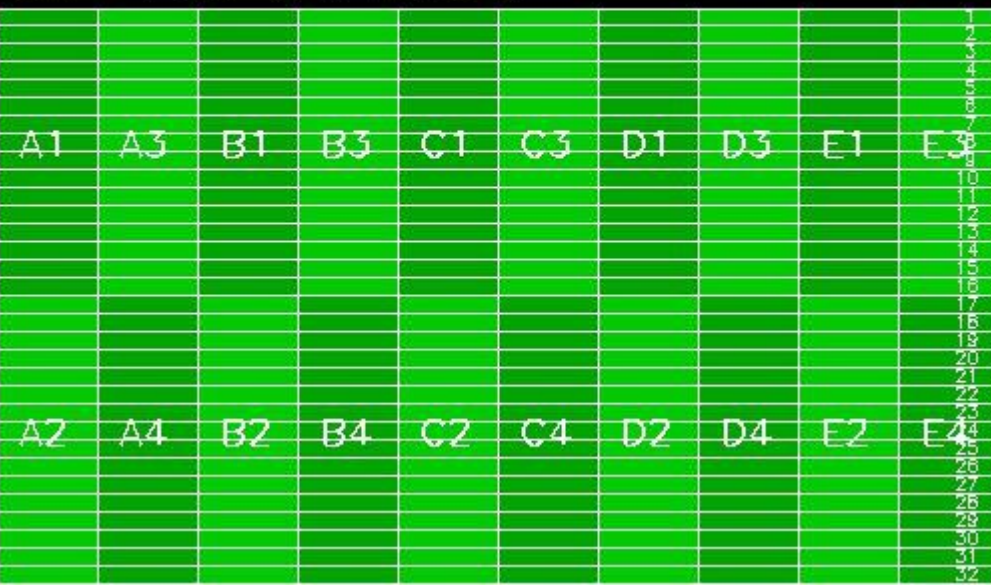


Reference: 2005-09-22 06:26:51 H RxPhase
 Test : 2009-10-05 09:21:54 H



Reference: 2009-10-03 08:44:32 H RxPhase
 Test : 2009-10-05 09:21:54 H



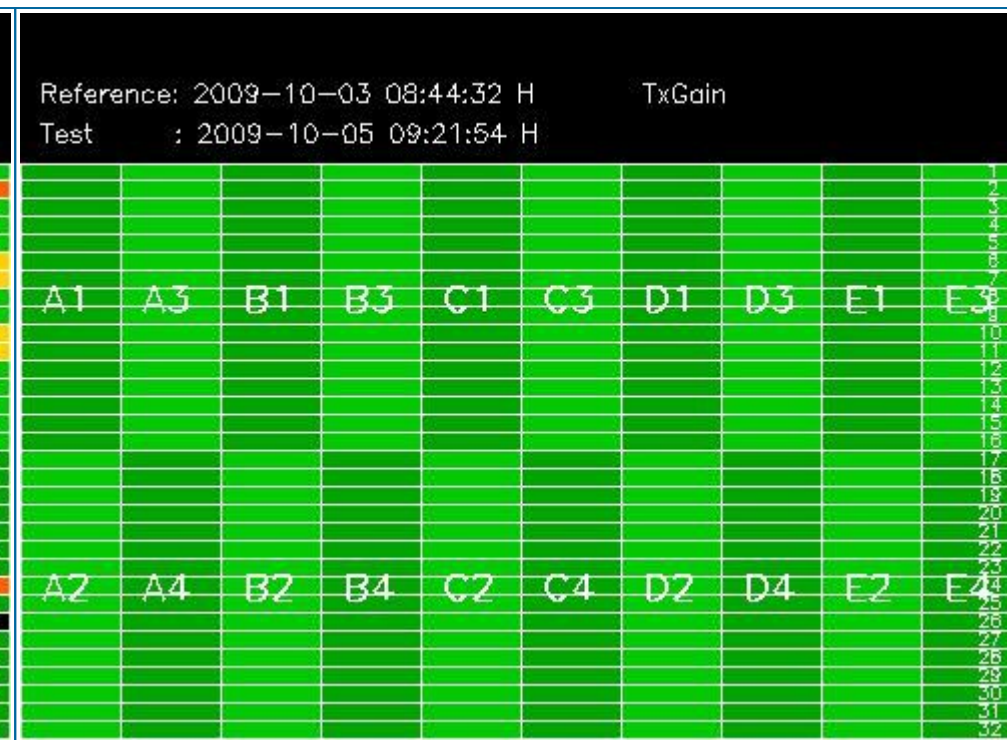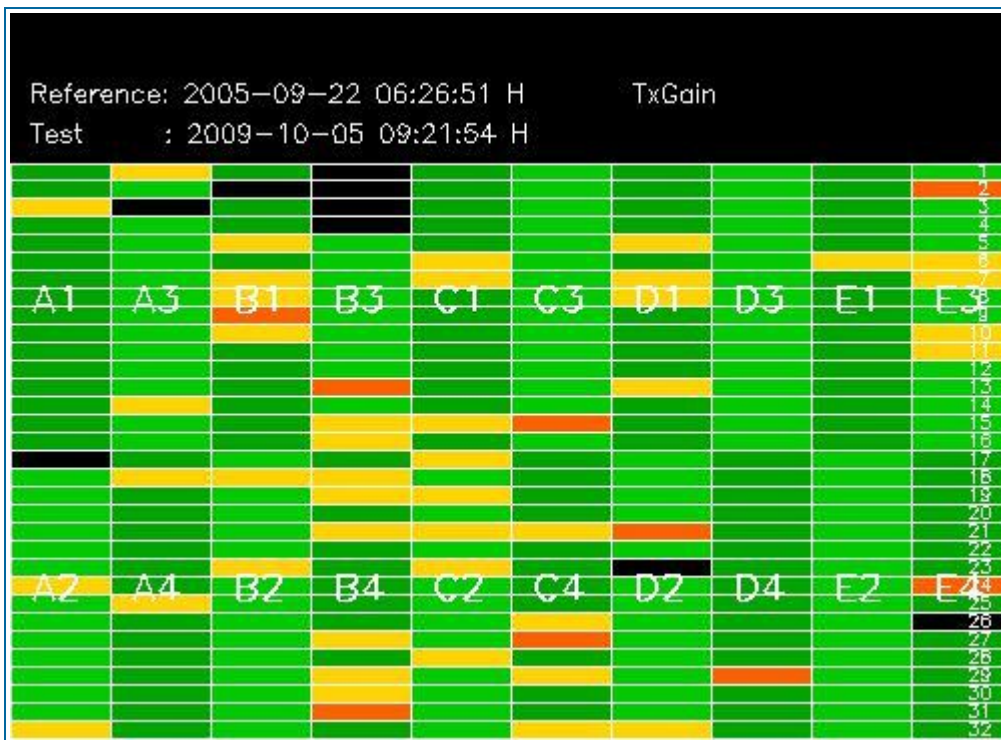

4 - CALIBRATION PULSES ANALYSIS

4.1 - Analysis for WVS IS2 V/V


4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for WVS IS2 V/V

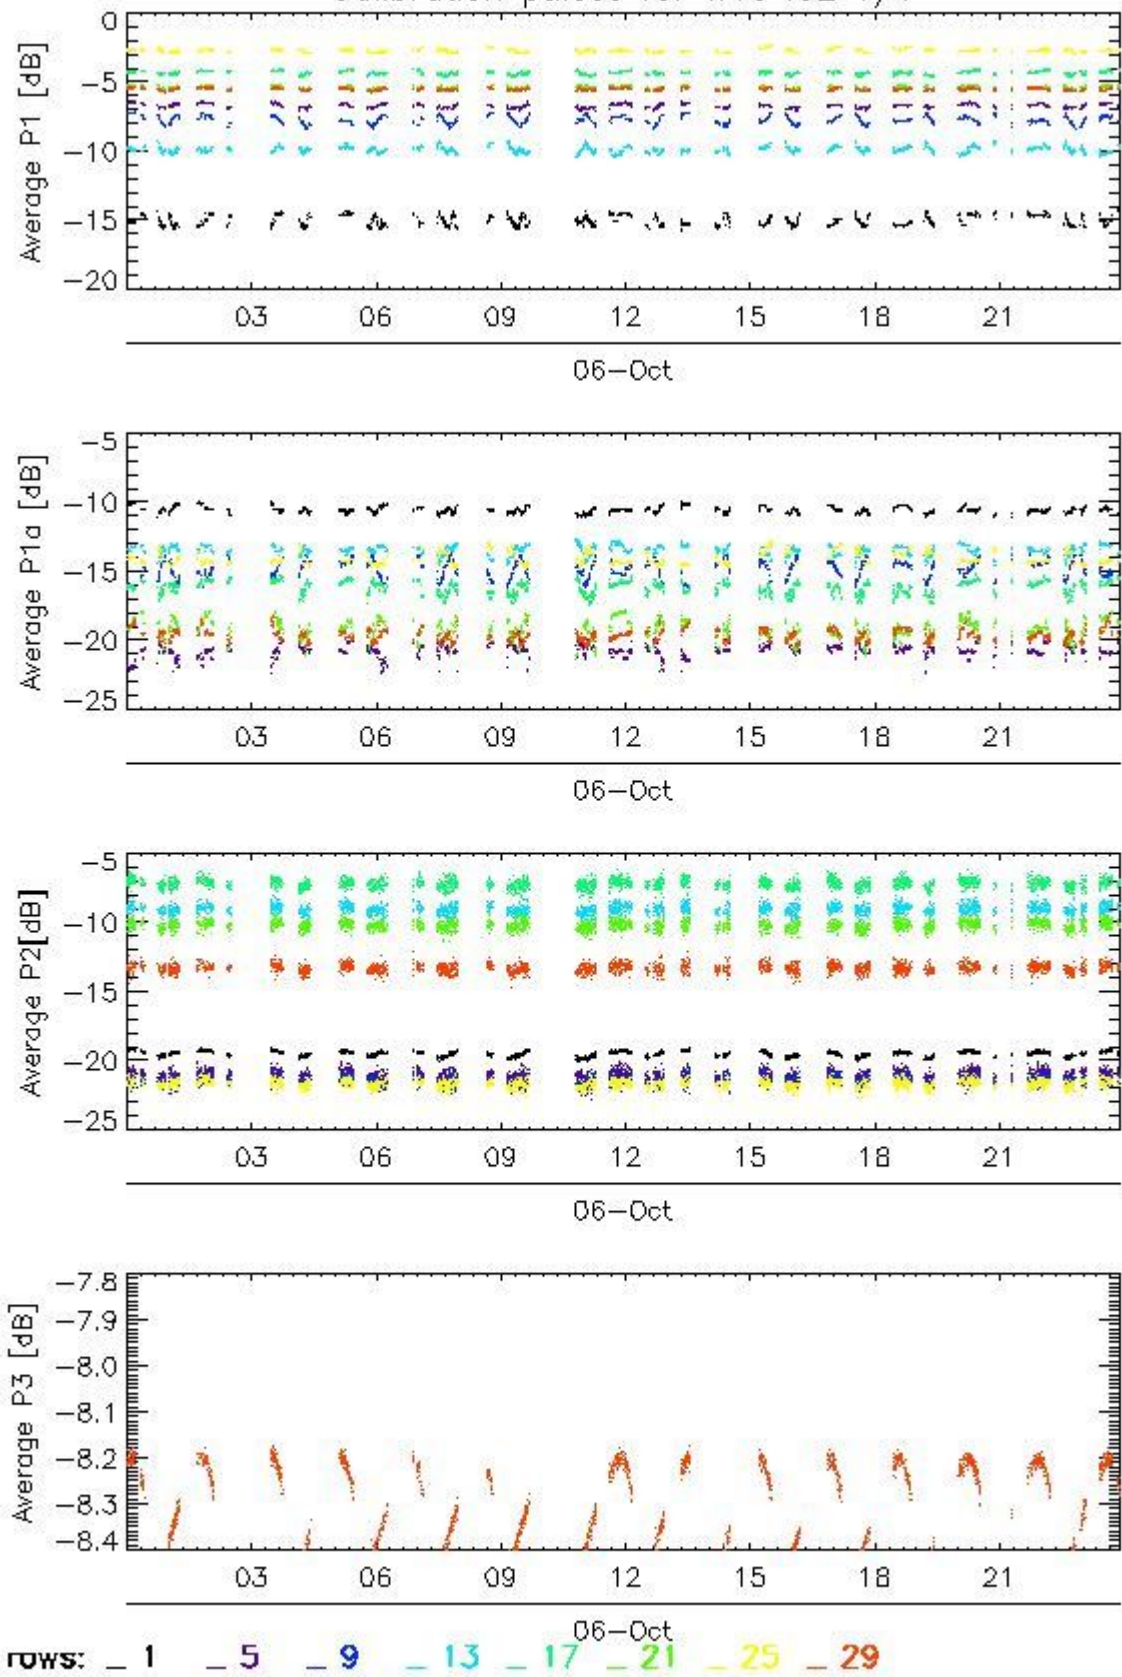


Transmit power (P1 - P1a) for WVS IS2 V/V

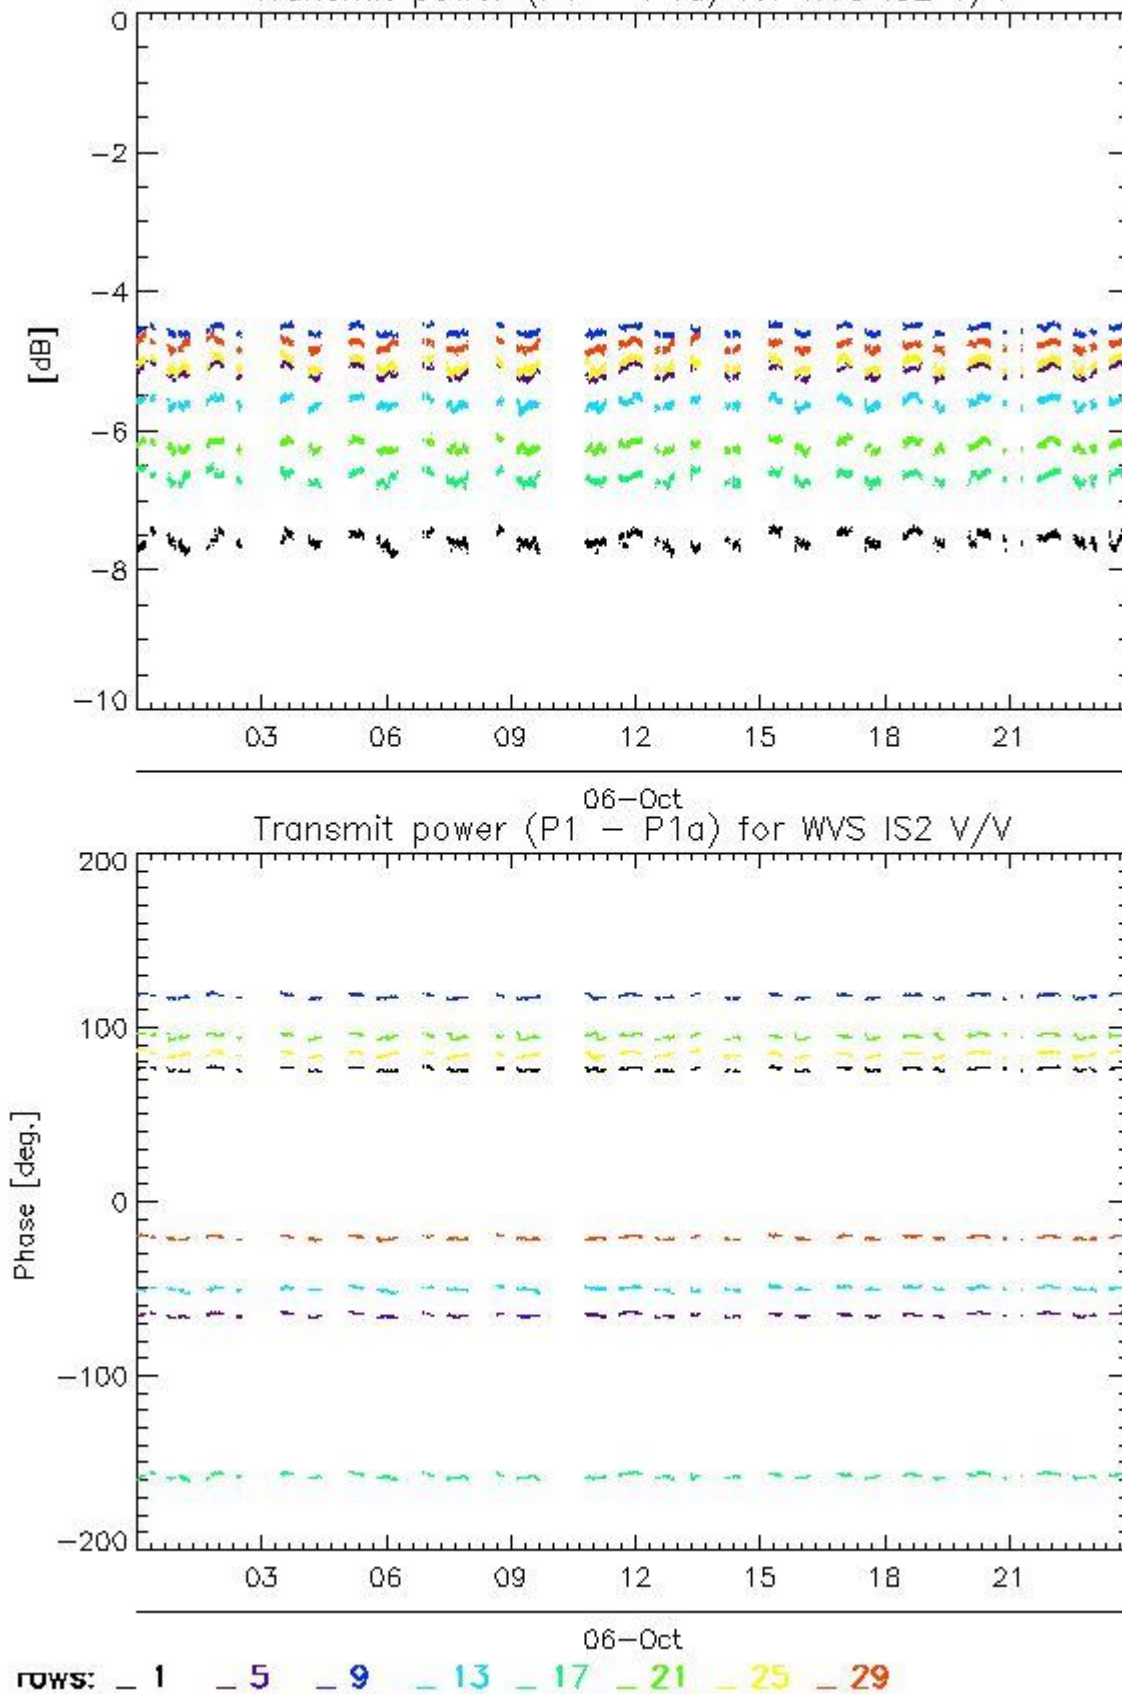

4.1.2 - All Rows Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



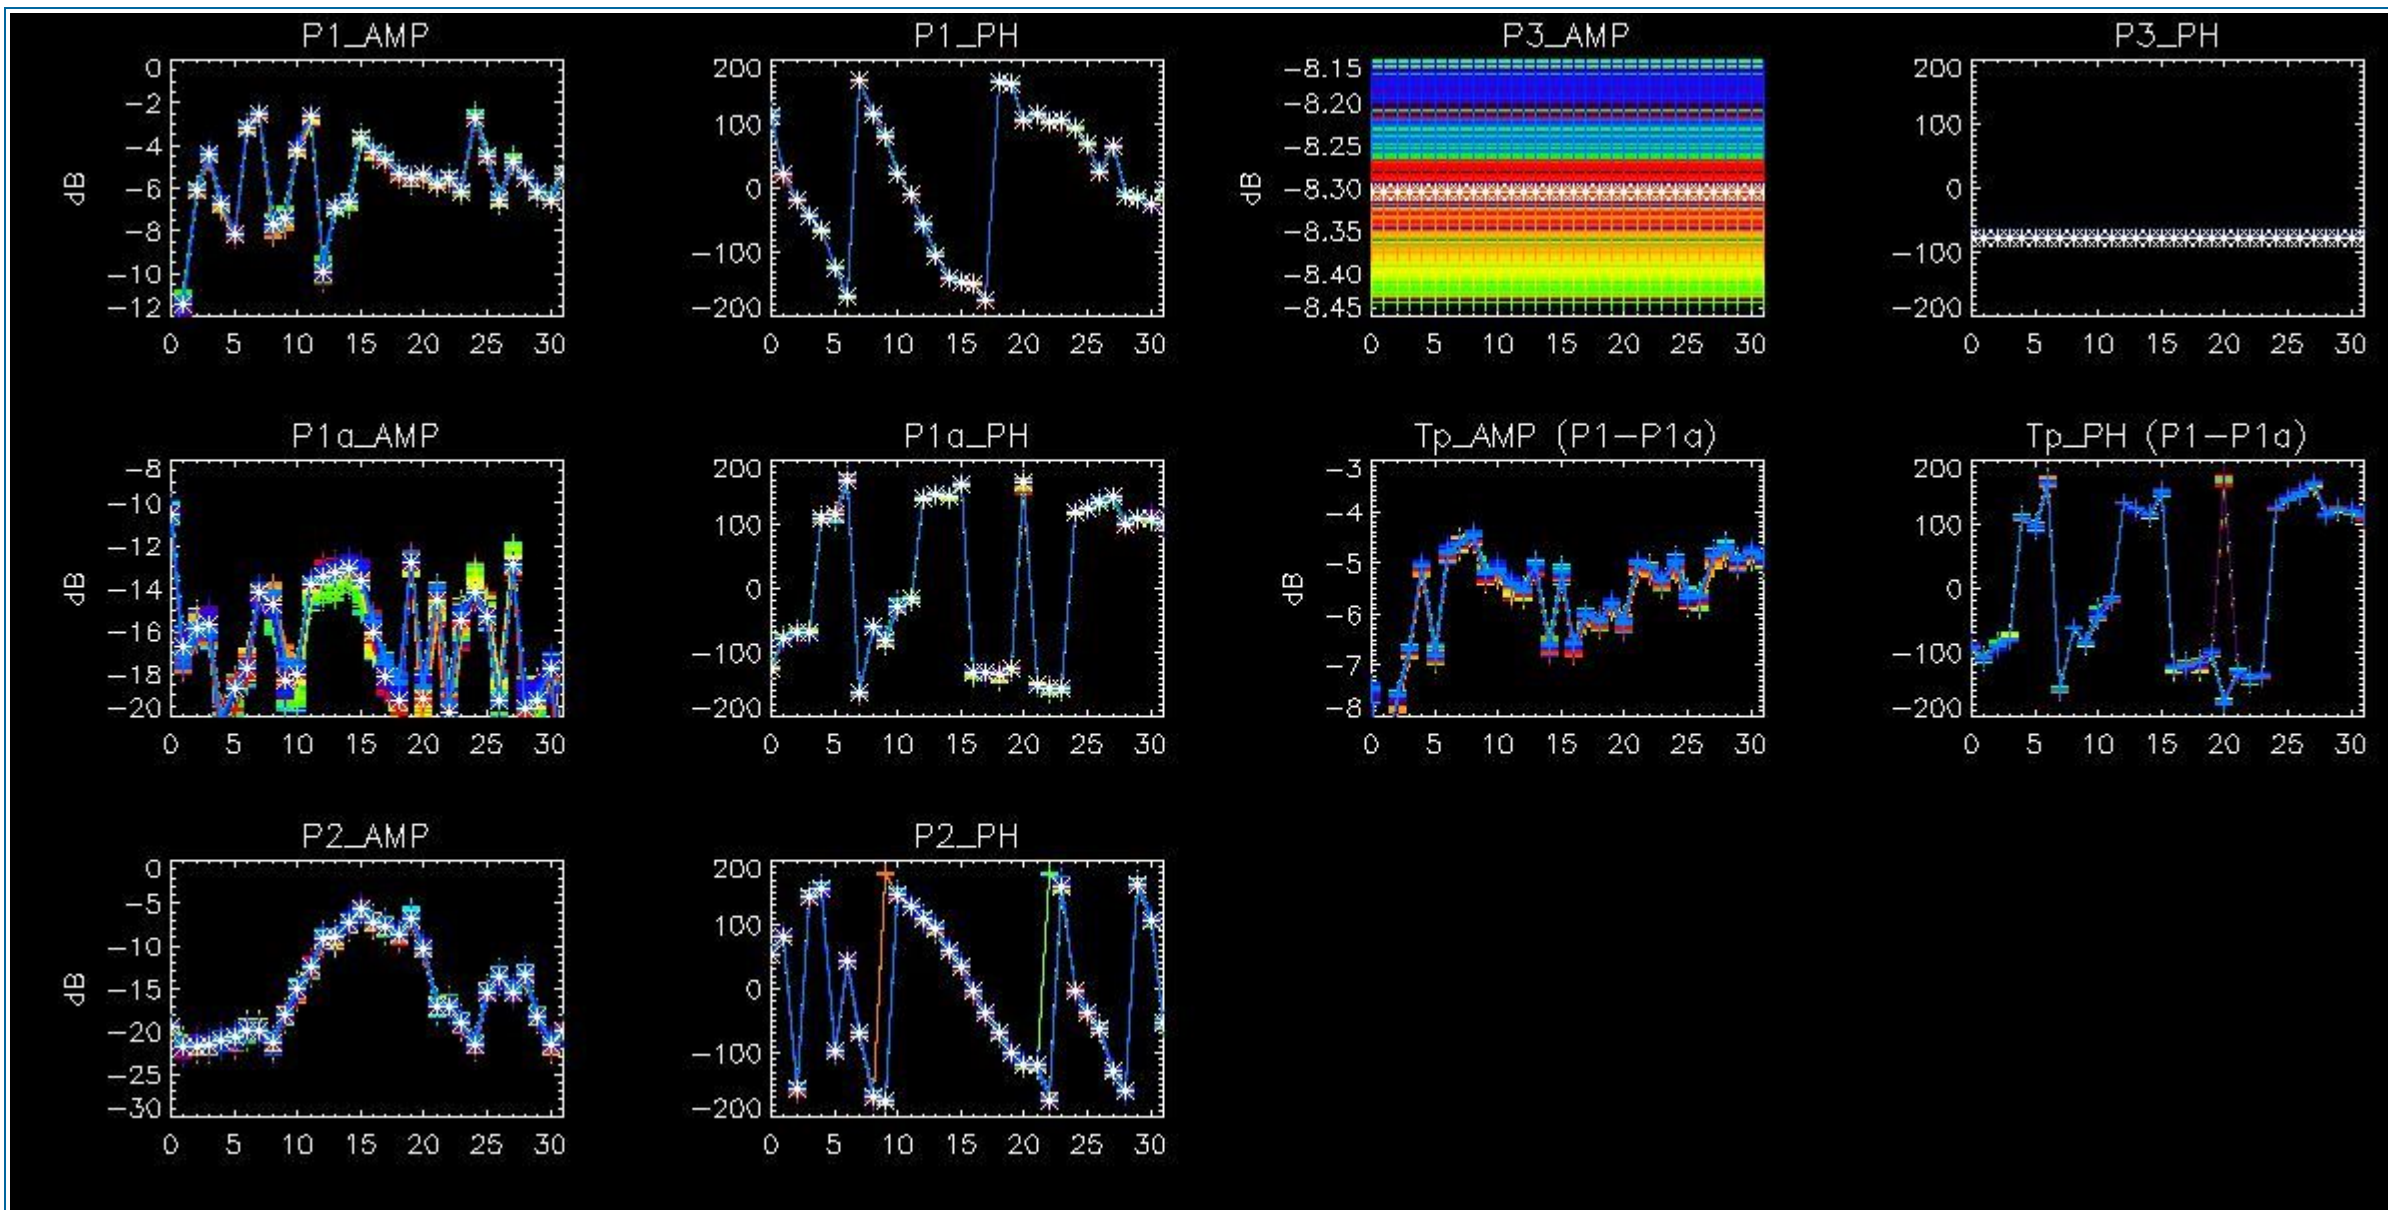

4.2 - Analysis for GM1 SS3 H/H


4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for GM1 SS3 H/H

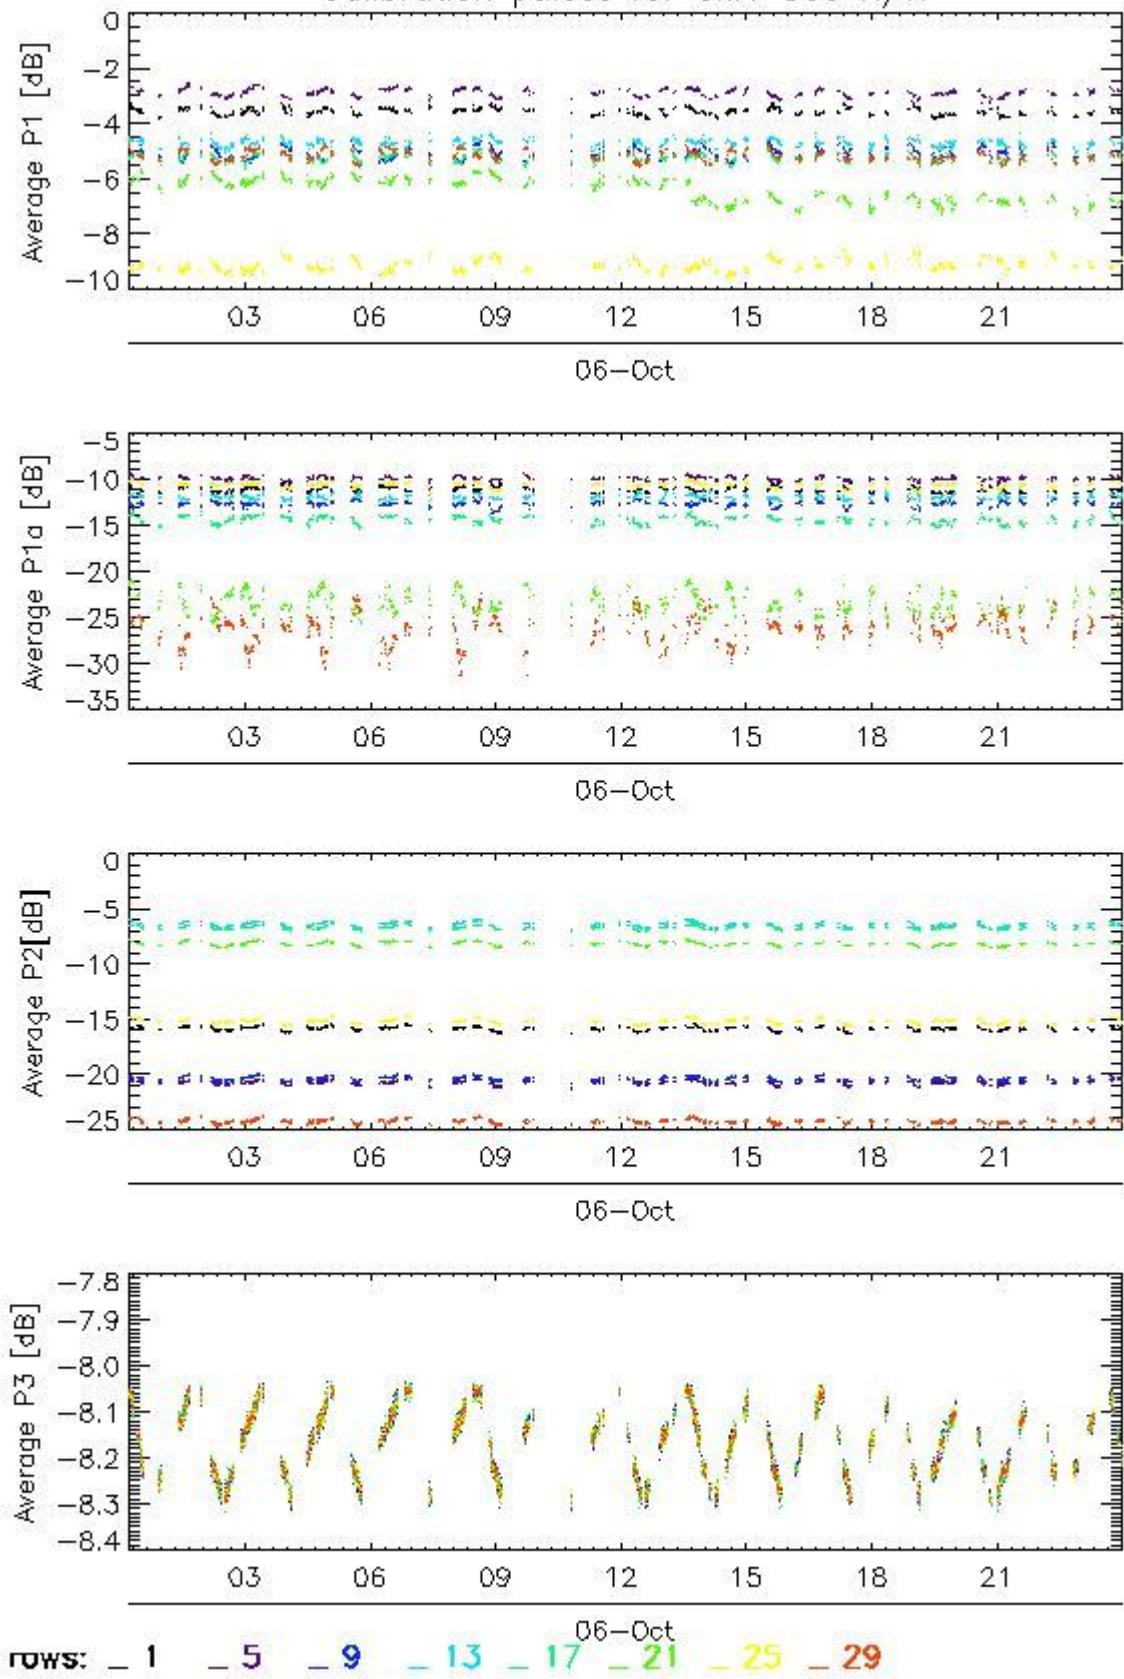


Transmit power (P1 - P1a) for GM1 SS3 H/H

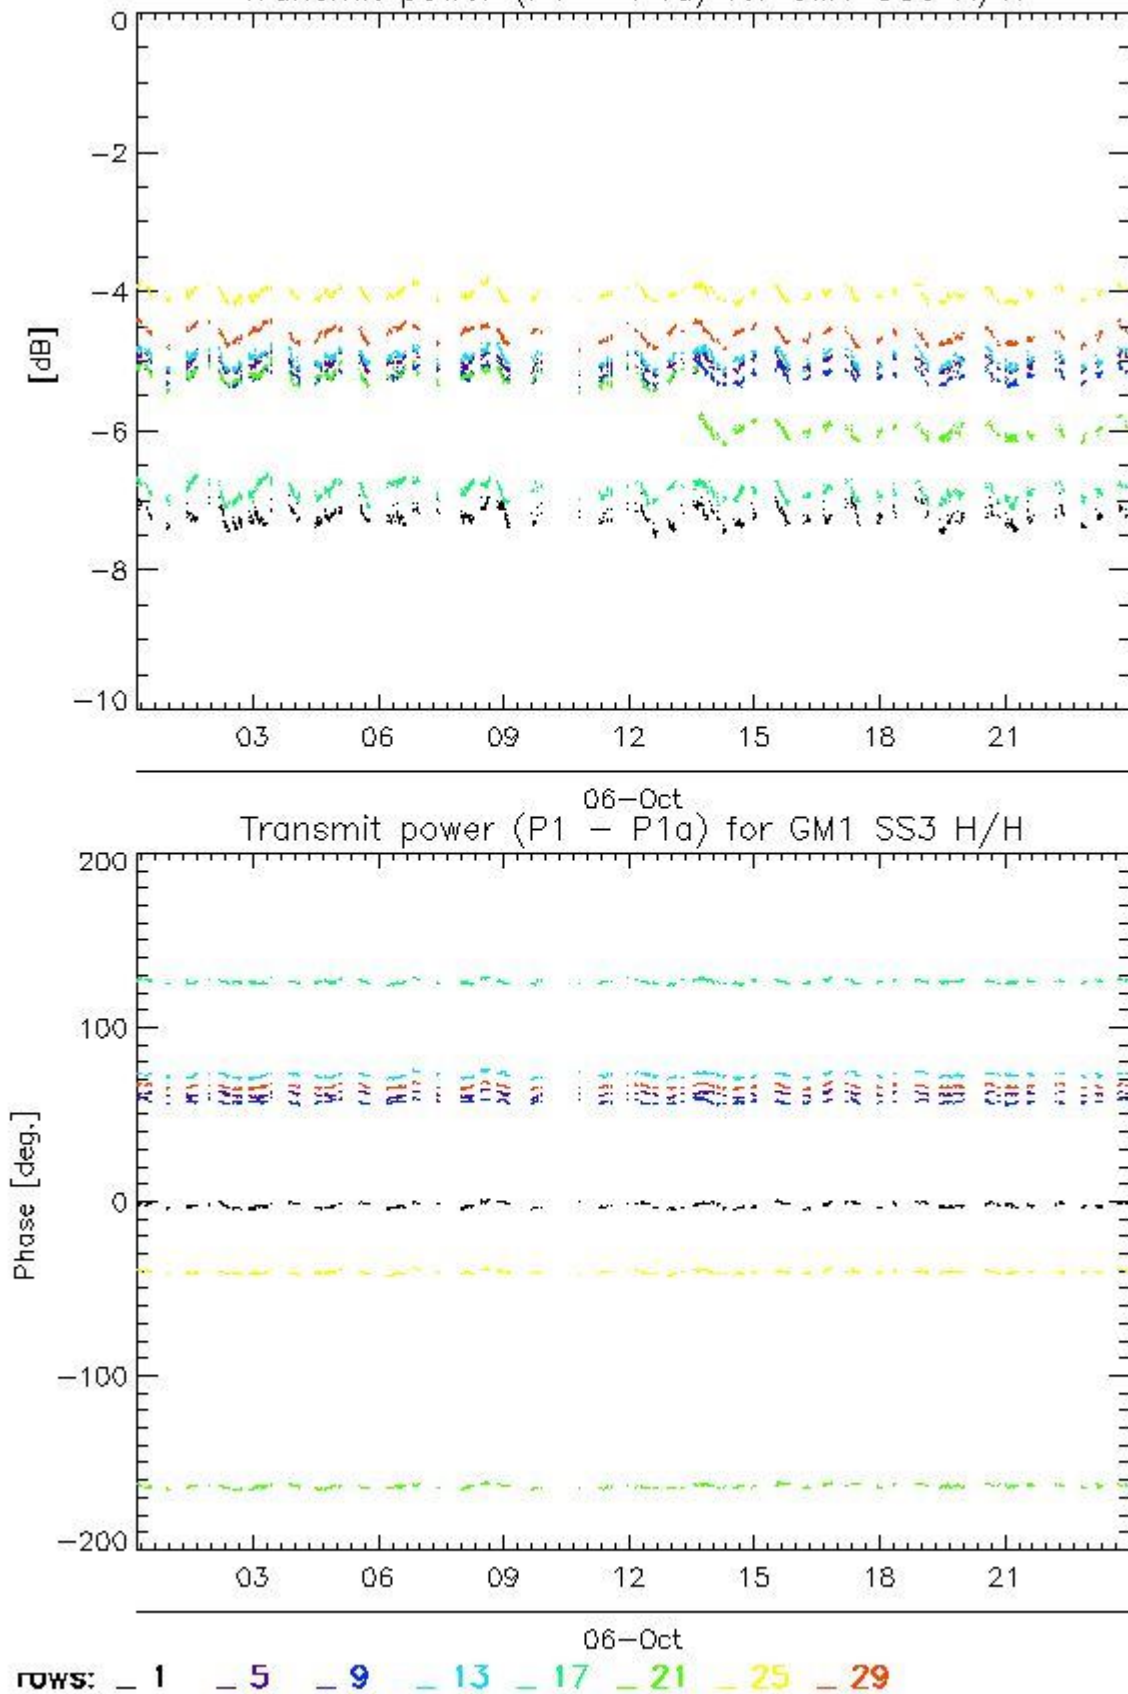

4.2.2 - All Rows Analysis for GM1 SS3 H/H

[[BACK TO MENU](#)]



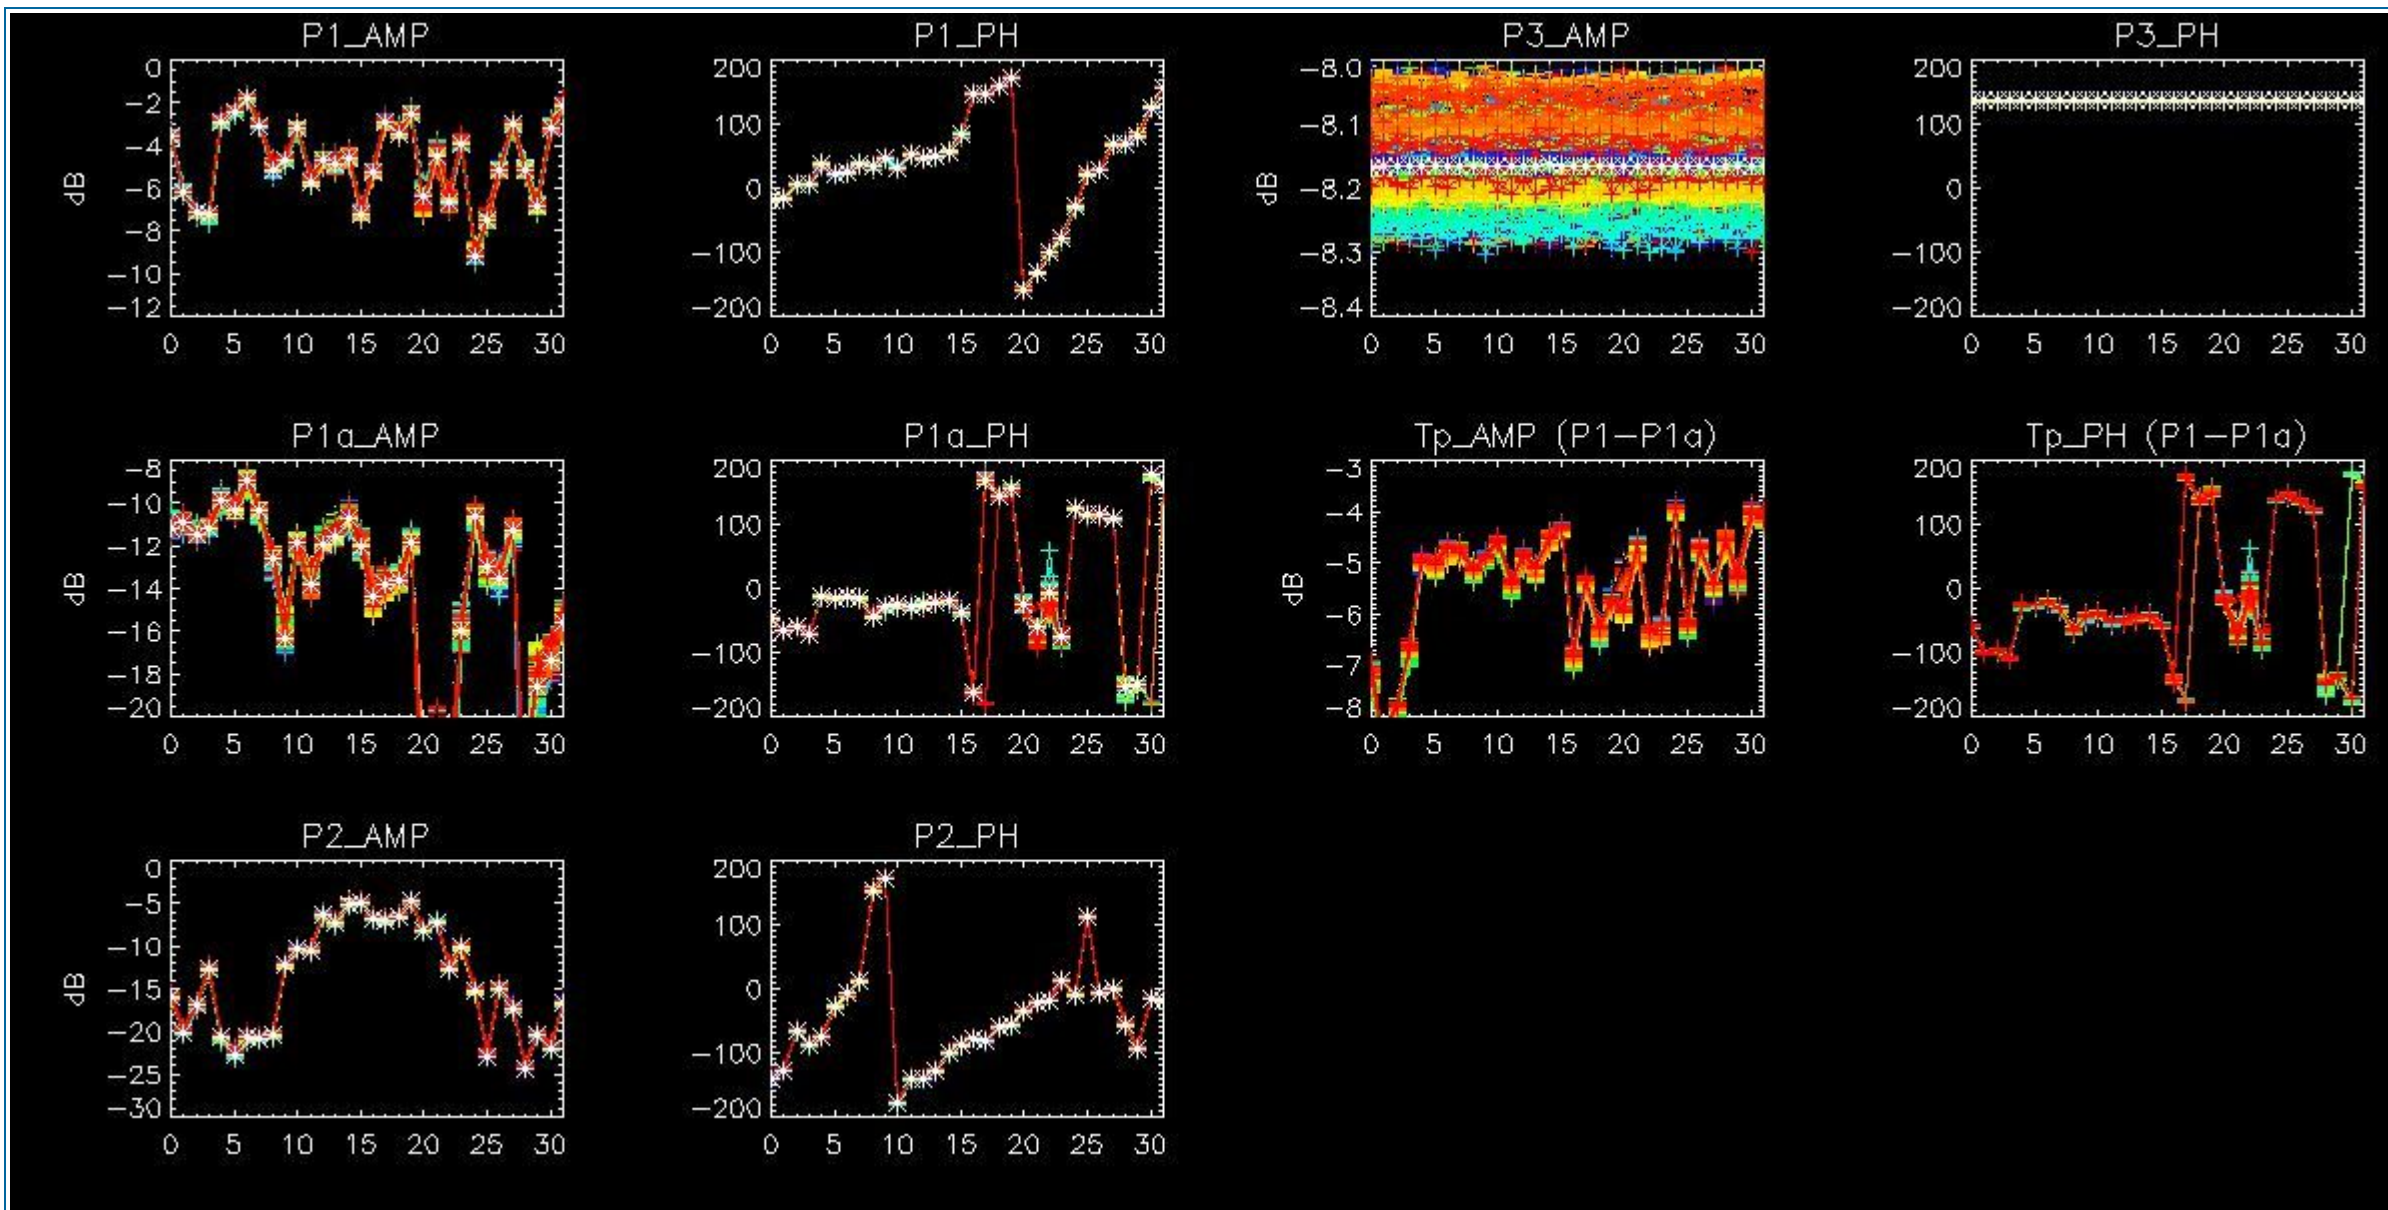


5 - DOPPLER ANALYSIS

5.1 - Analysis for WVS IS2 V/V

5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]




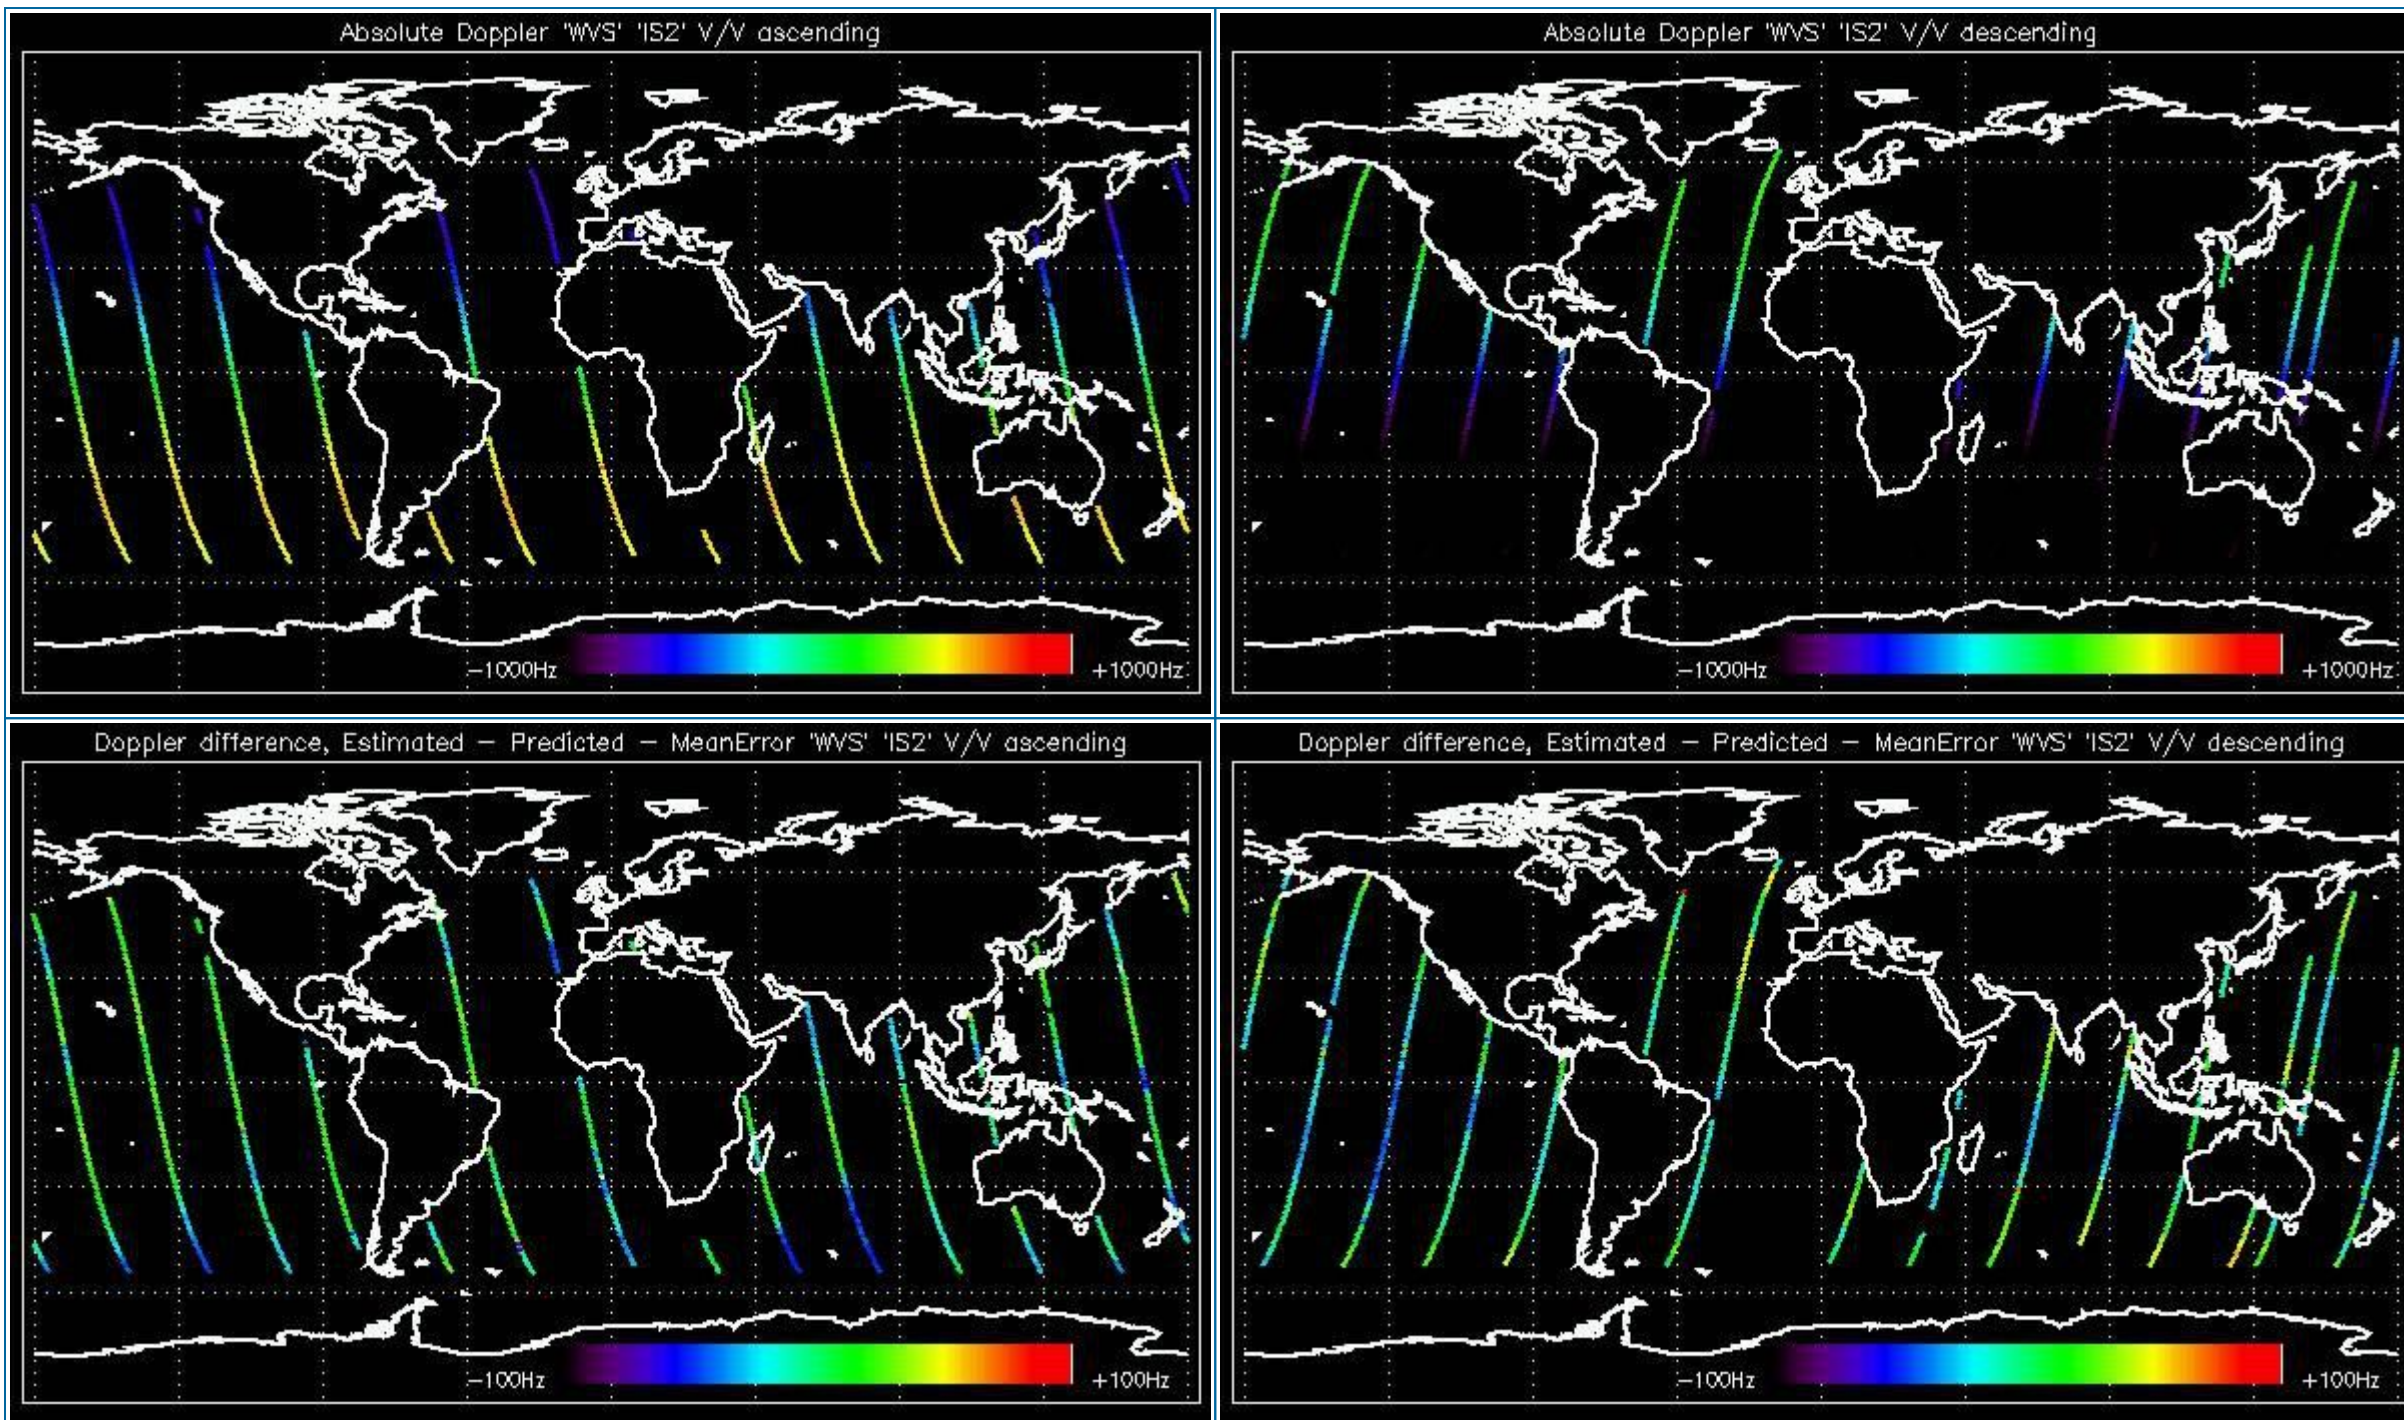

5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



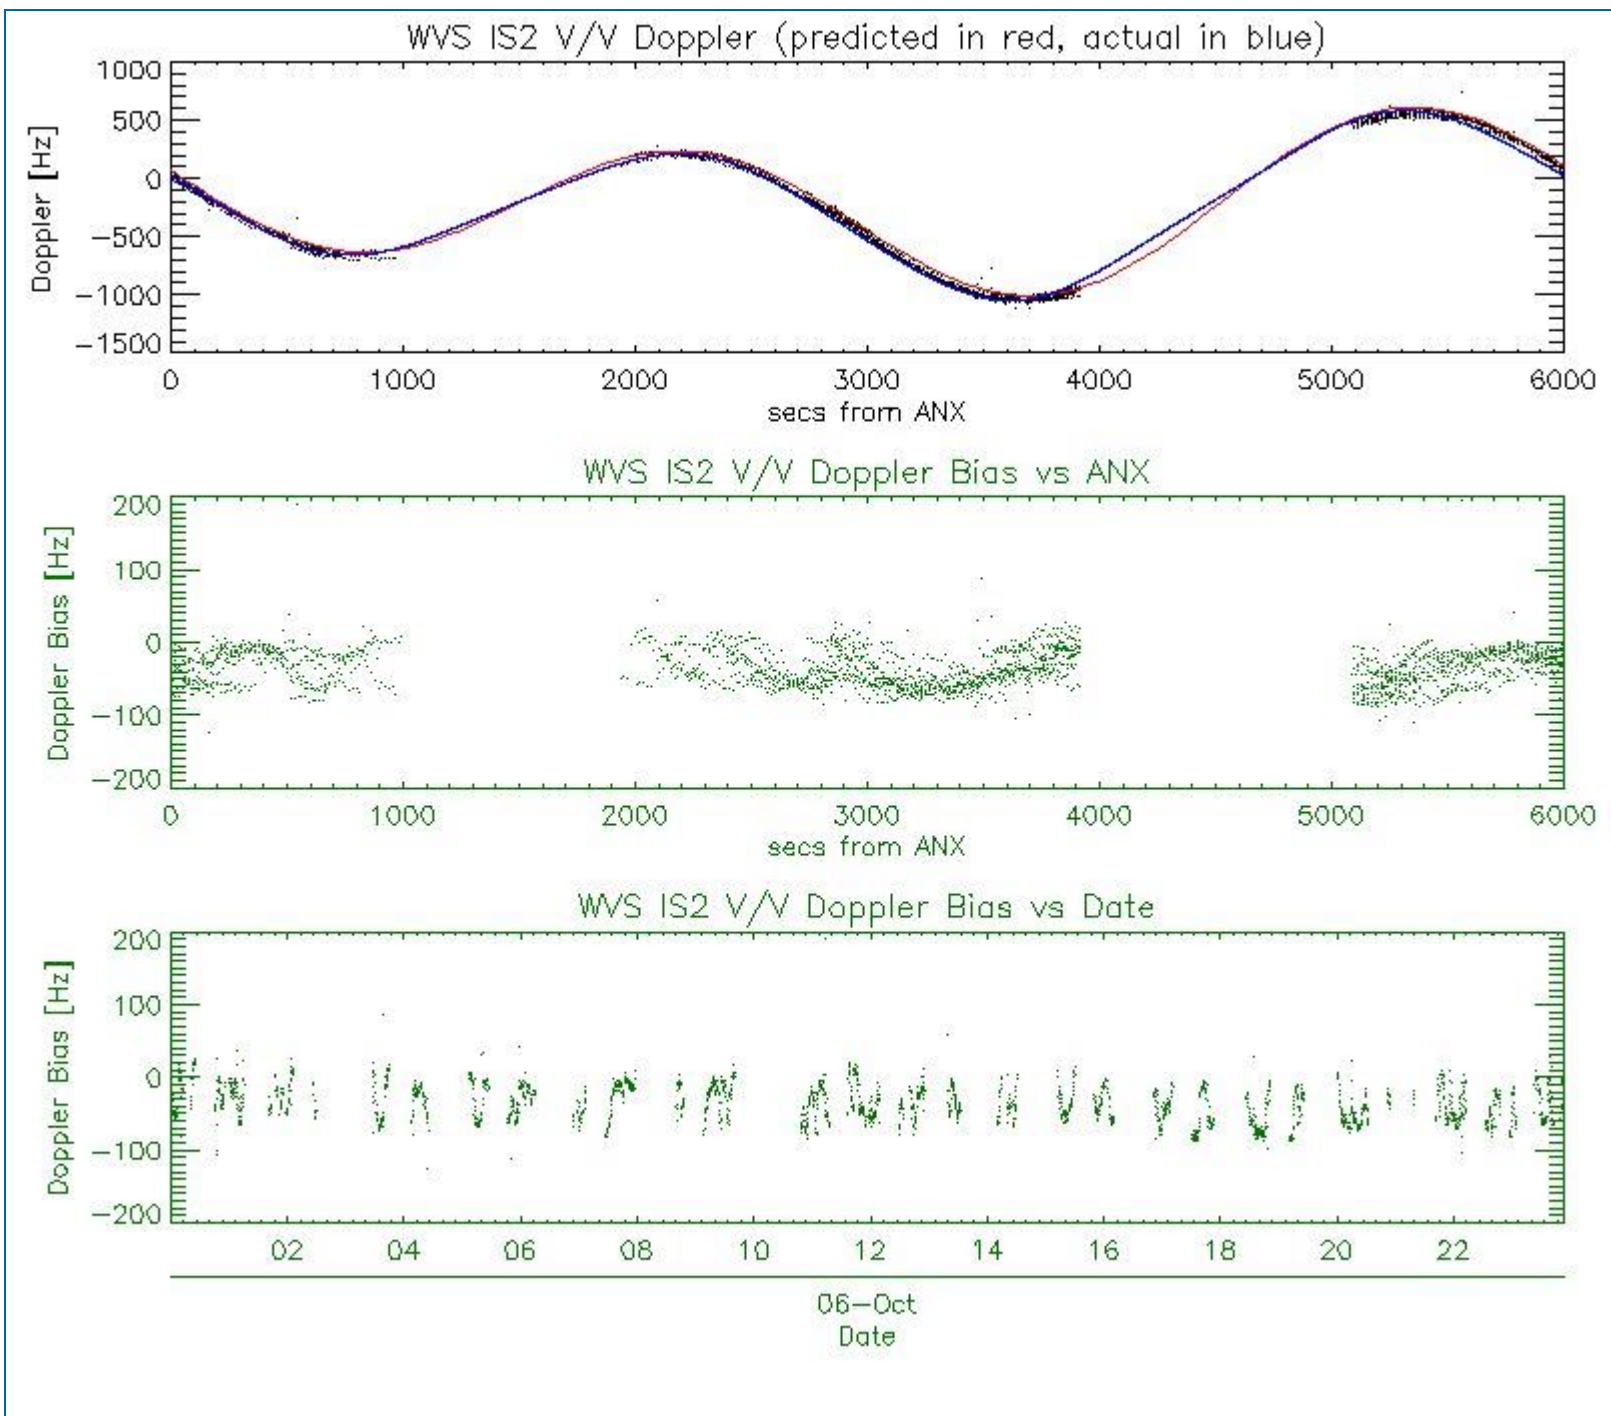


5.2 - Analysis for GM1 SS1 H/H

5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




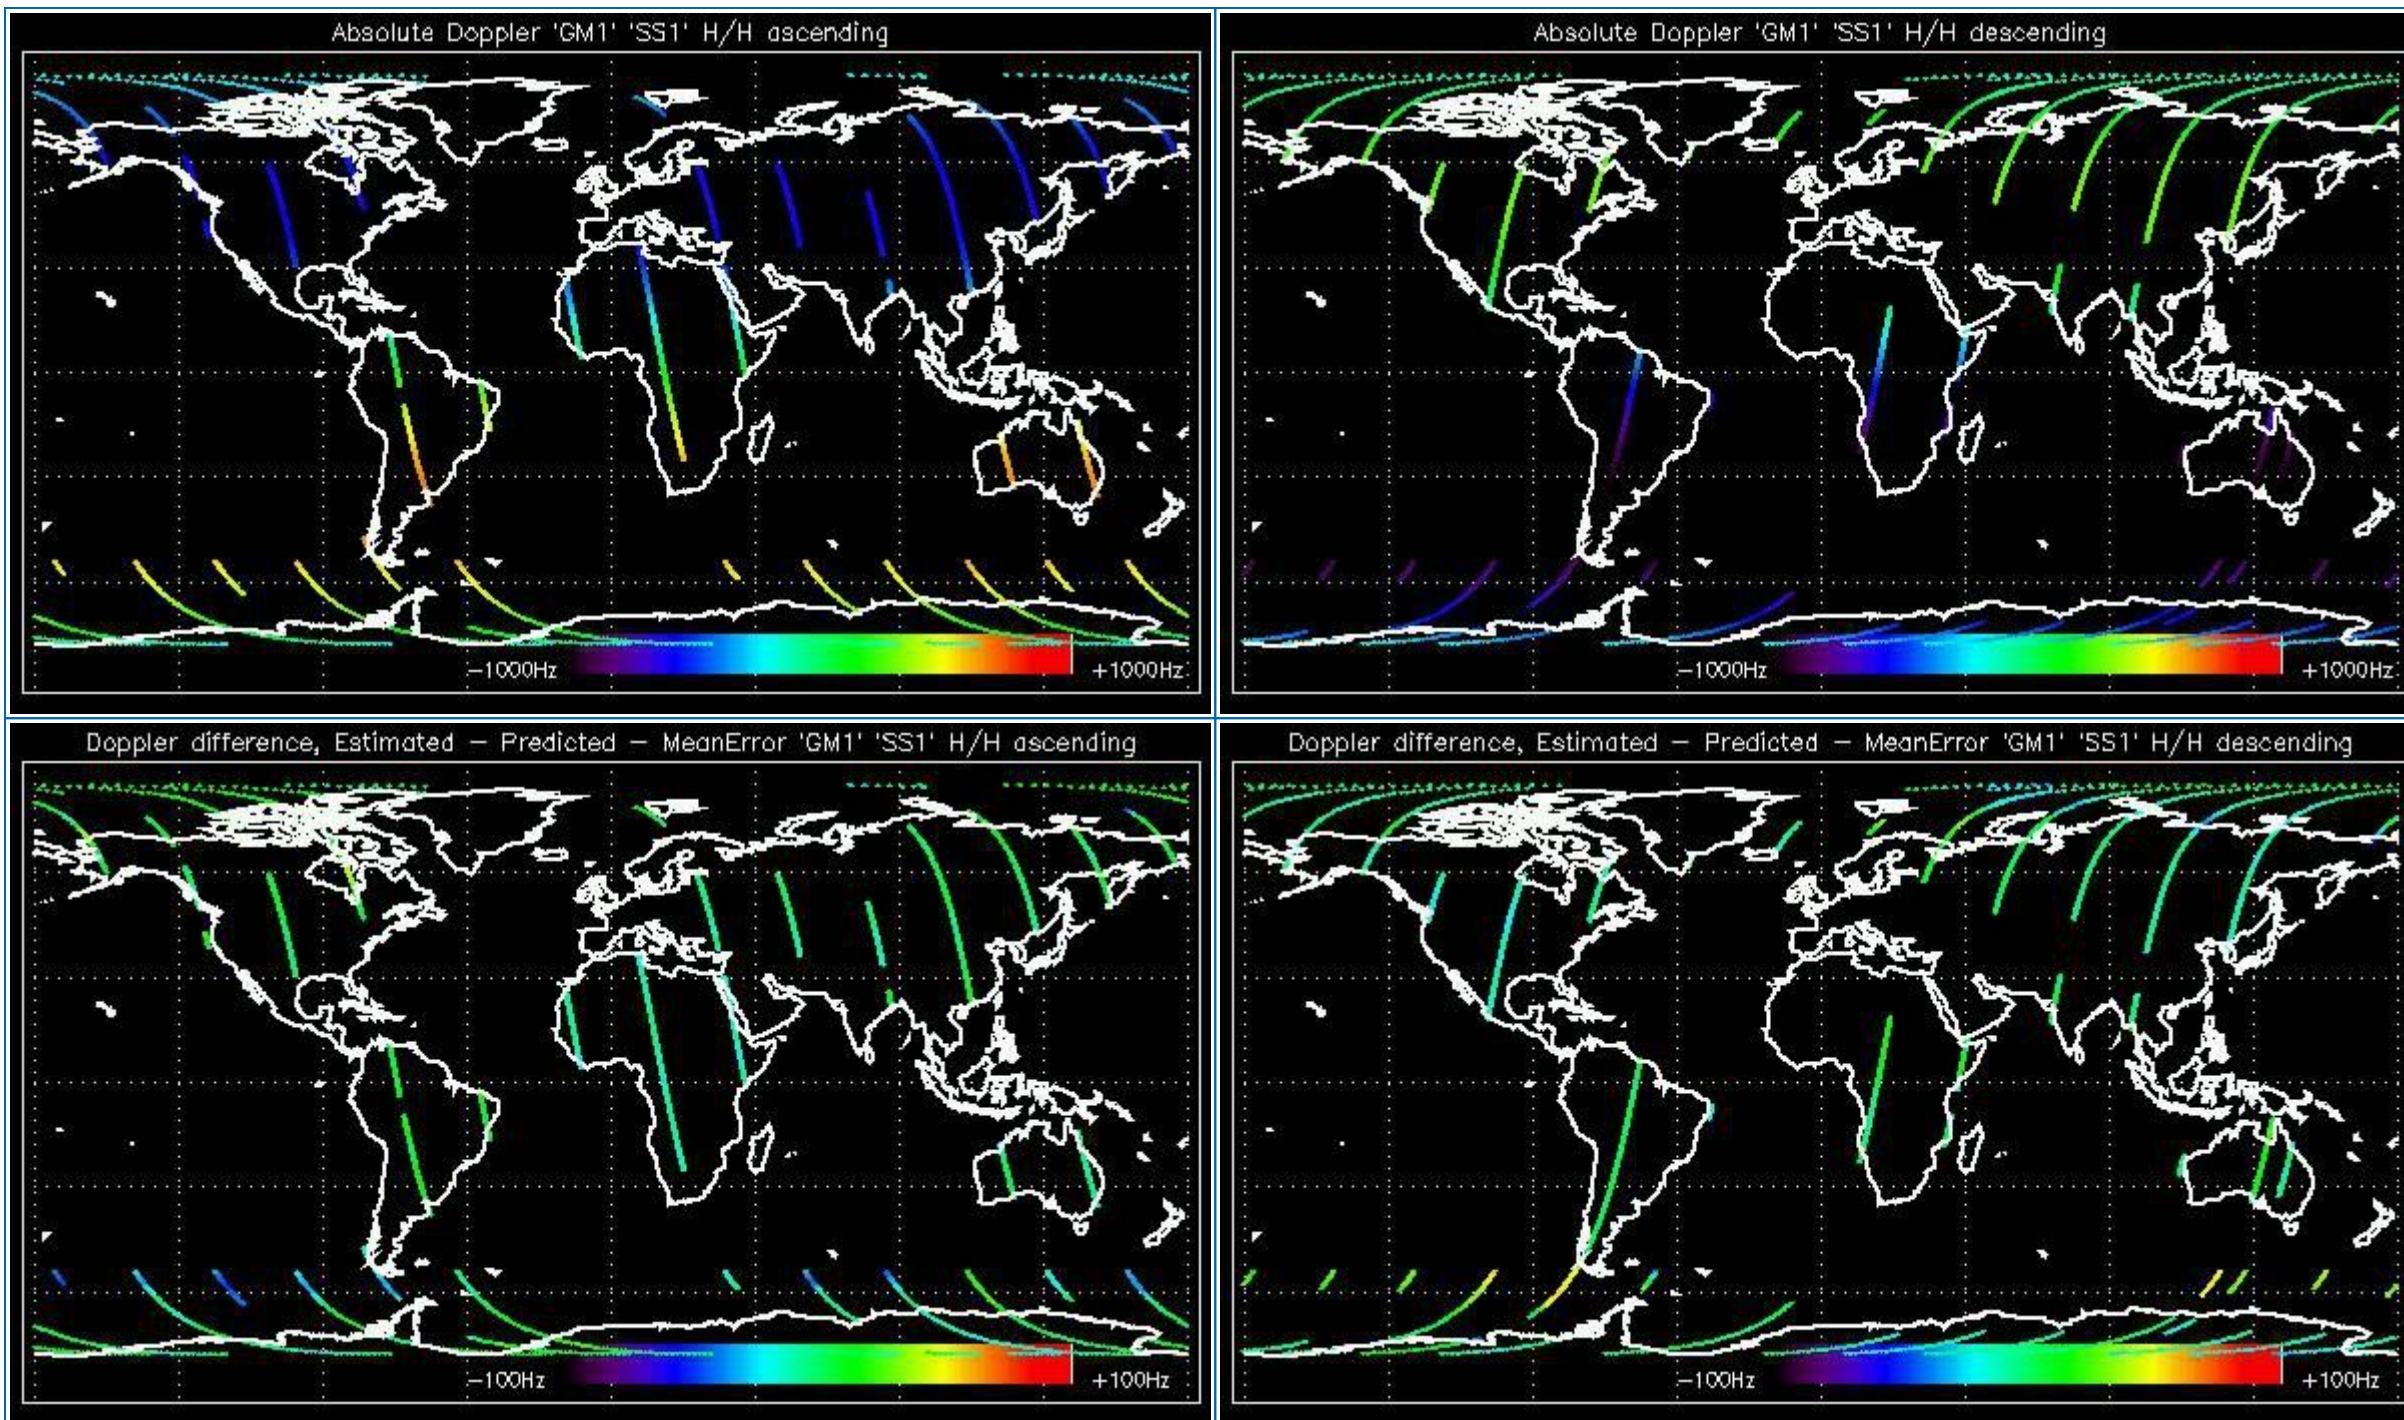

5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




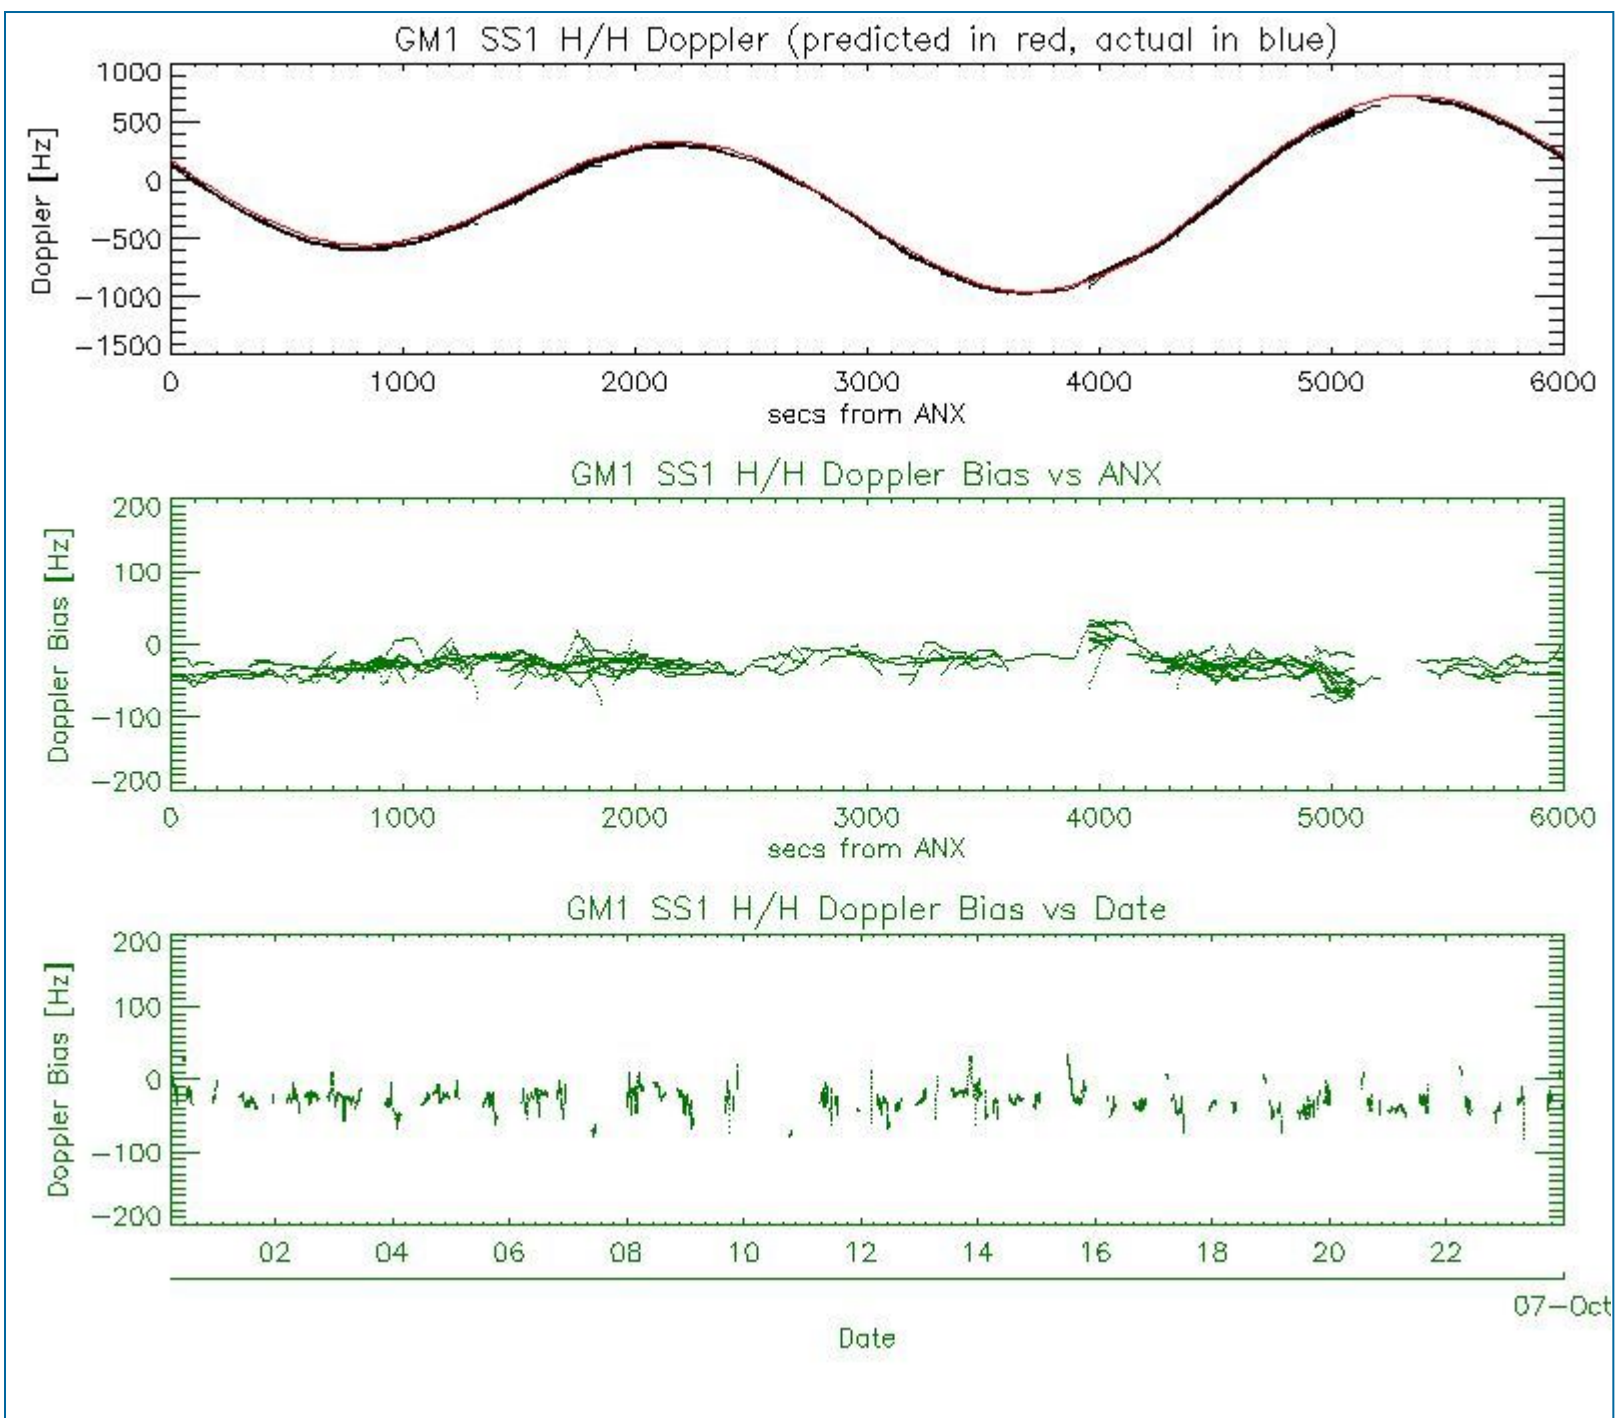

5.3 - Doppler JUMPS Analysis for WSM

[BACK TO MENU]



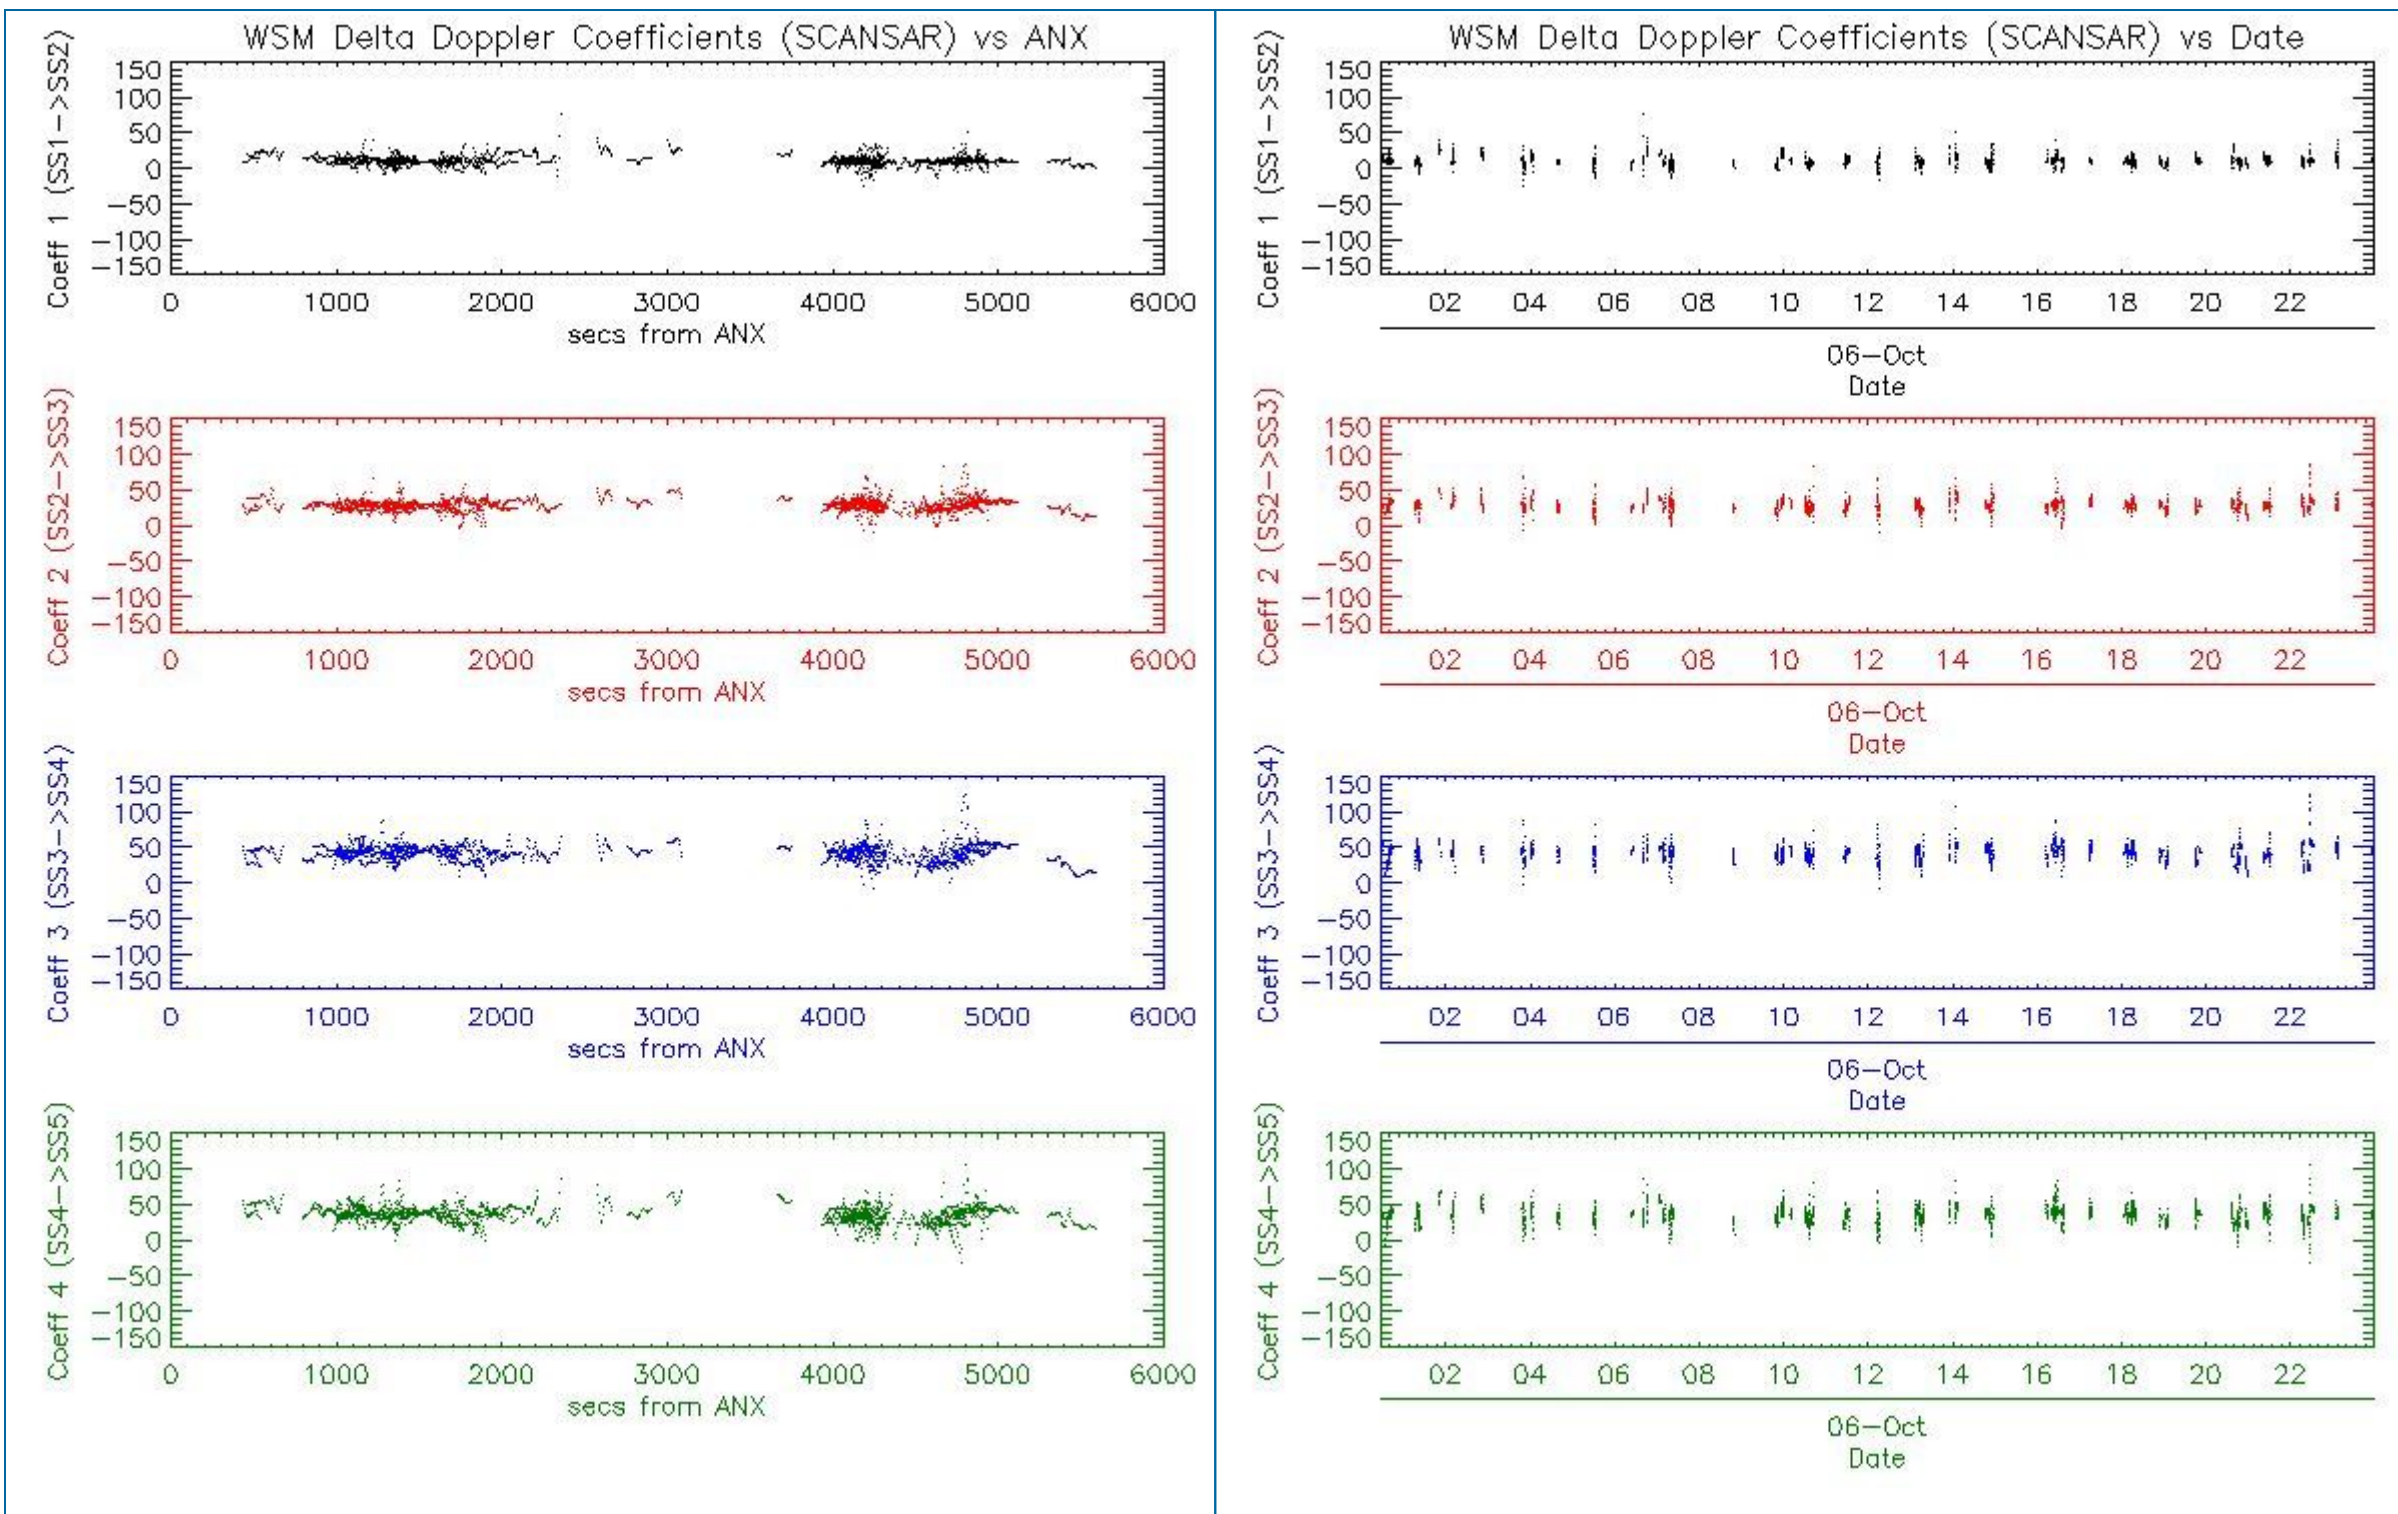



6 - CHIRP ANALYSIS

6.1 - Analysis for WSM SS1 H/H

6.1.1 - ScaleFactor

[[BACK TO MENU](#)]





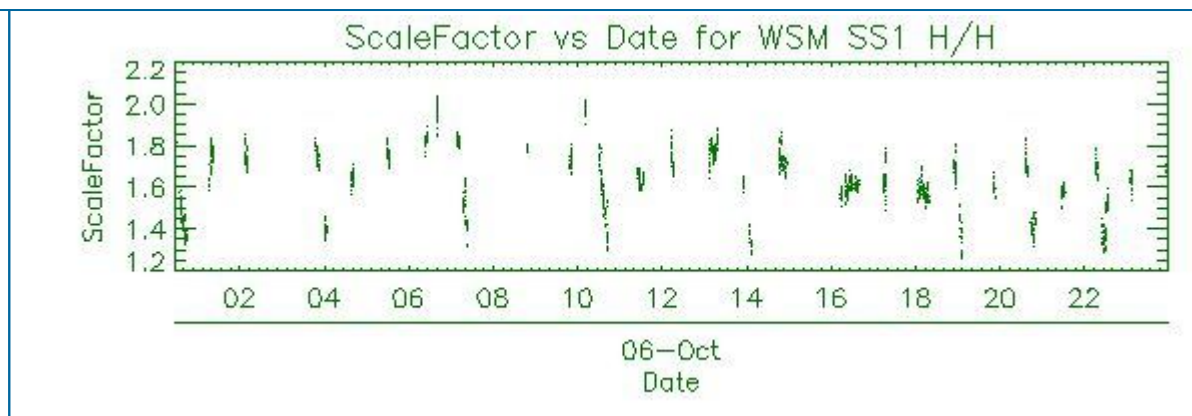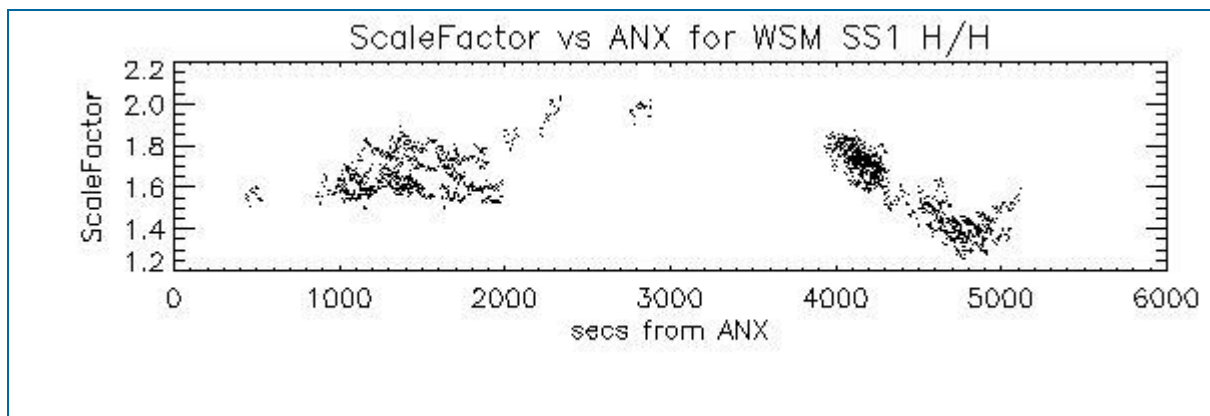

6.2 - Analysis for WSM SS1 V/V

6.2.1 - ScaleFactor

[[BACK TO MENU](#)]


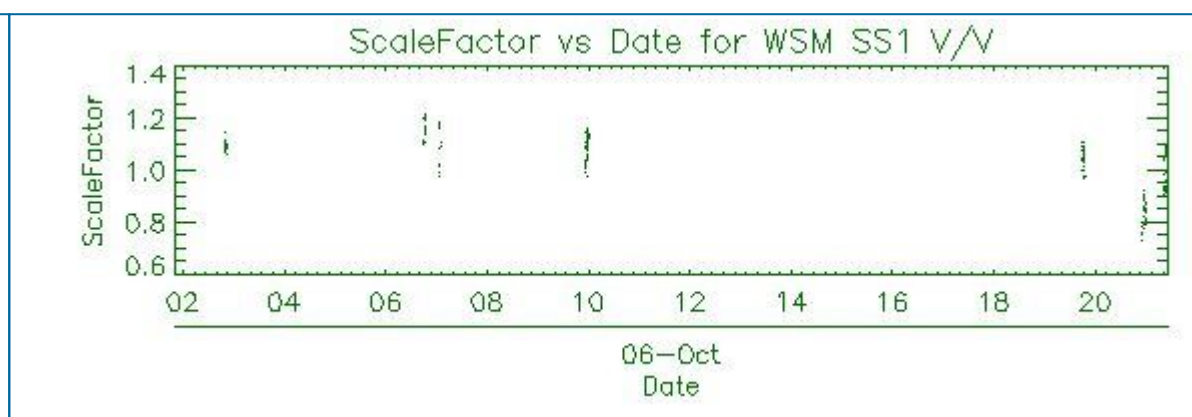
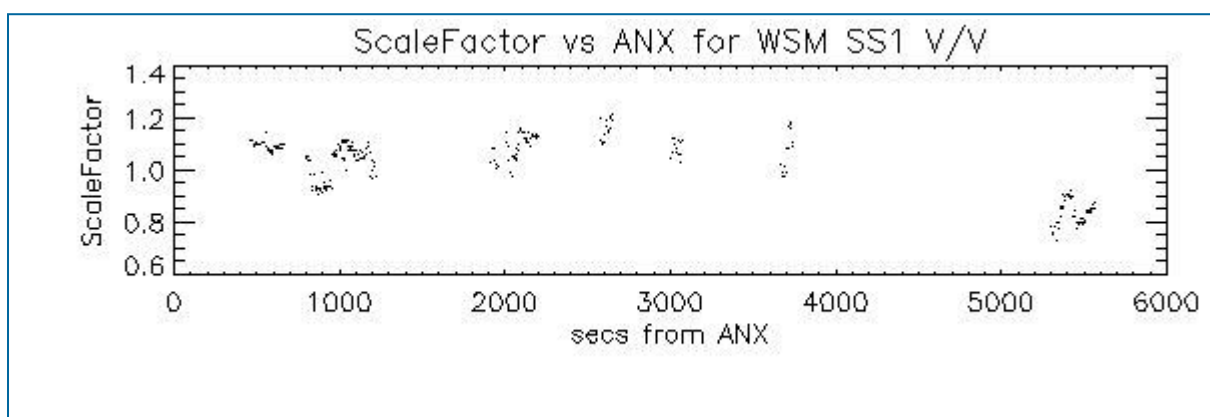


7 - RAW DATA ANALYSIS

7.1 - Analysis for WVS

[[BACK TO MENU](#)]

--	--	--

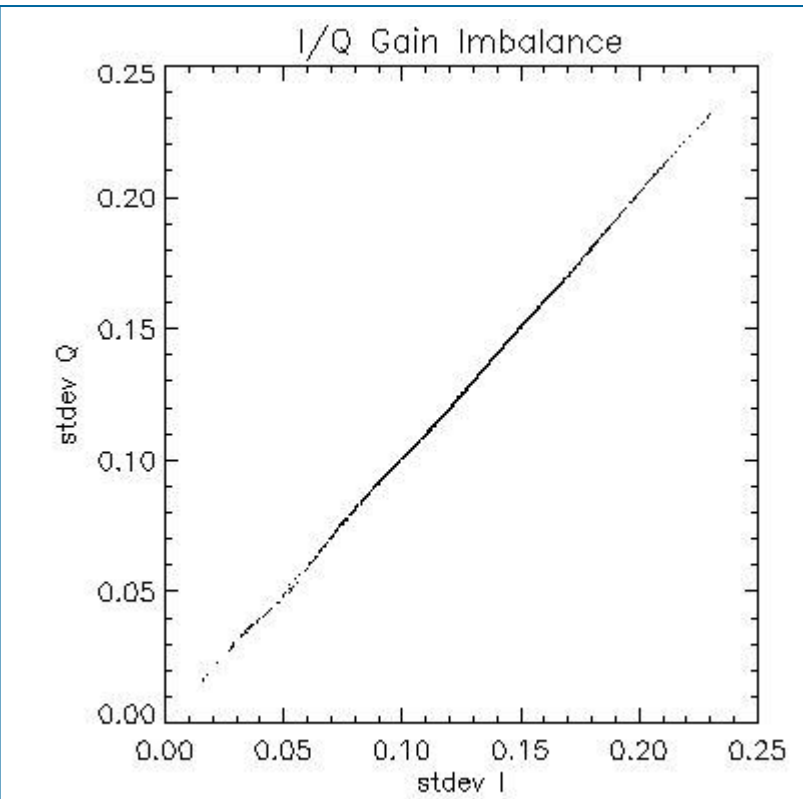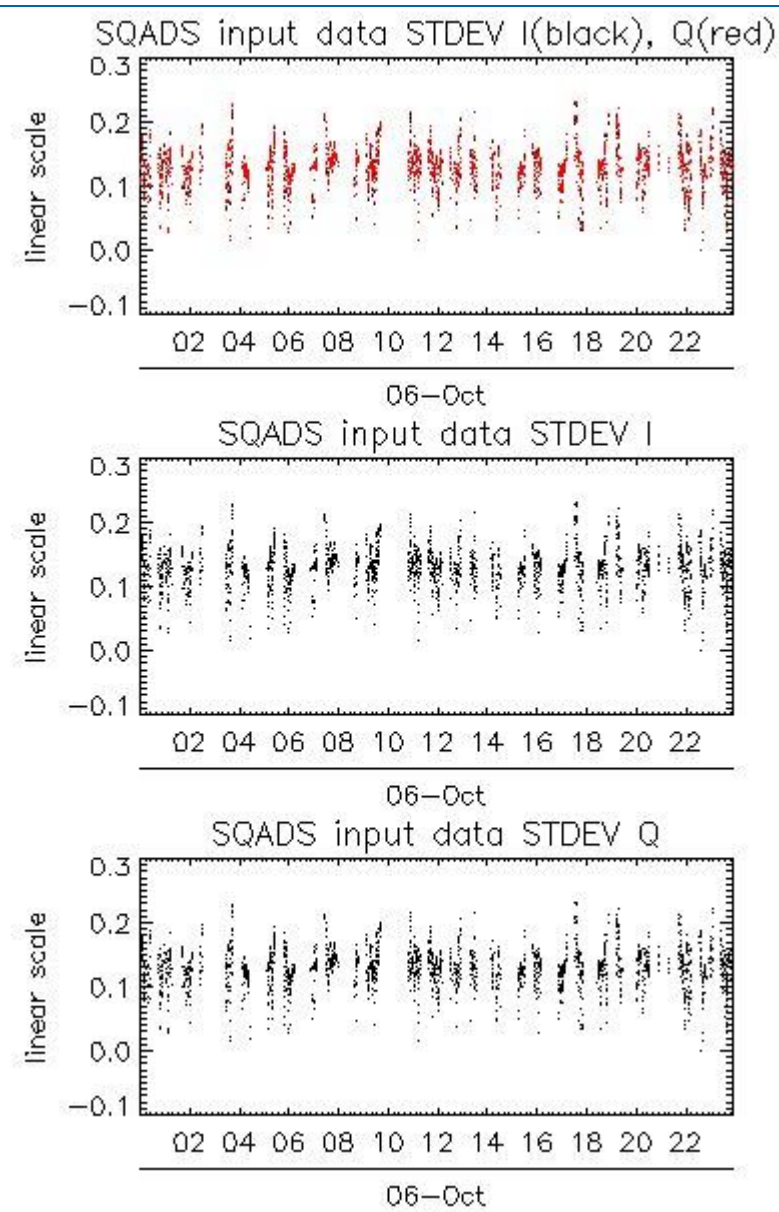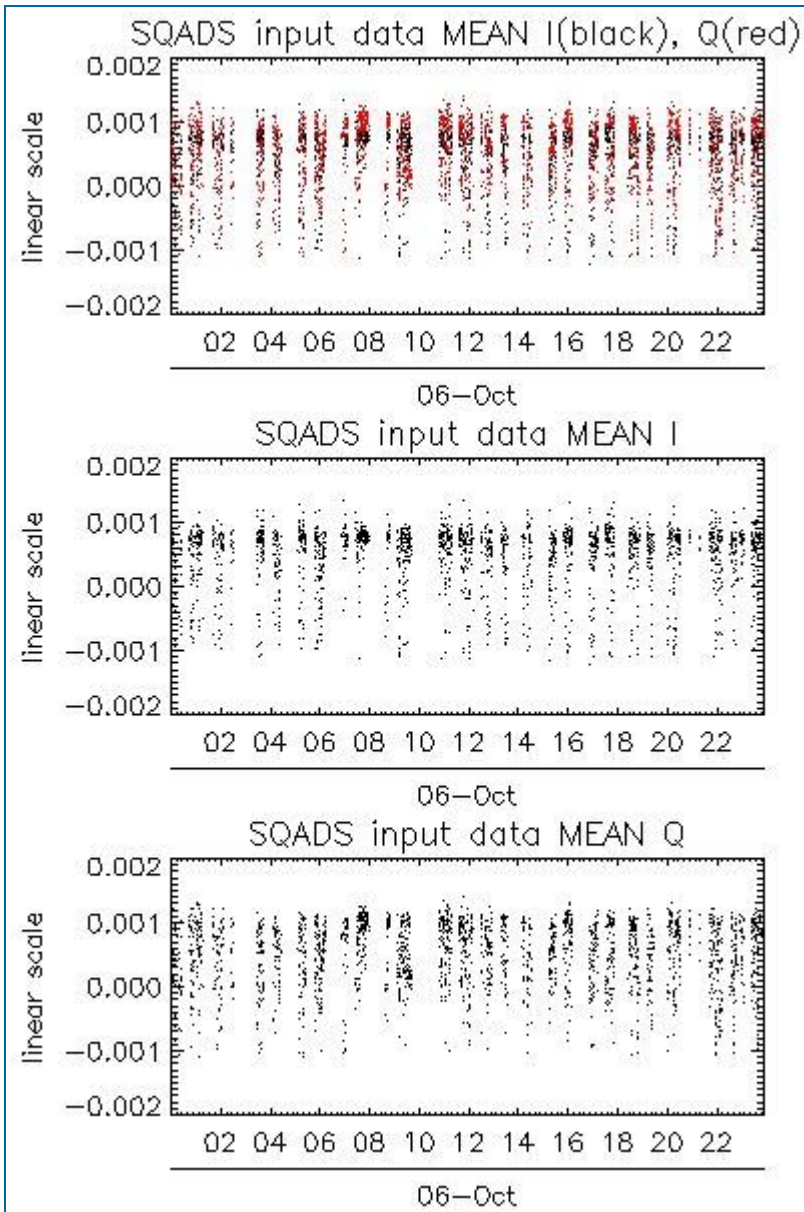


Channel	Statistics	DSS-B
MEAN I	mean	0.000483720
	stdev	2.41926e-07
MEAN Q	mean	0.000510810
	stdev	2.64955e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.128744
	stdev	0.000989769
STDEV Q	mean	0.129093
	stdev	0.000999965

7.2 - Analysis for IMM

[[BACK TO MENU](#)]



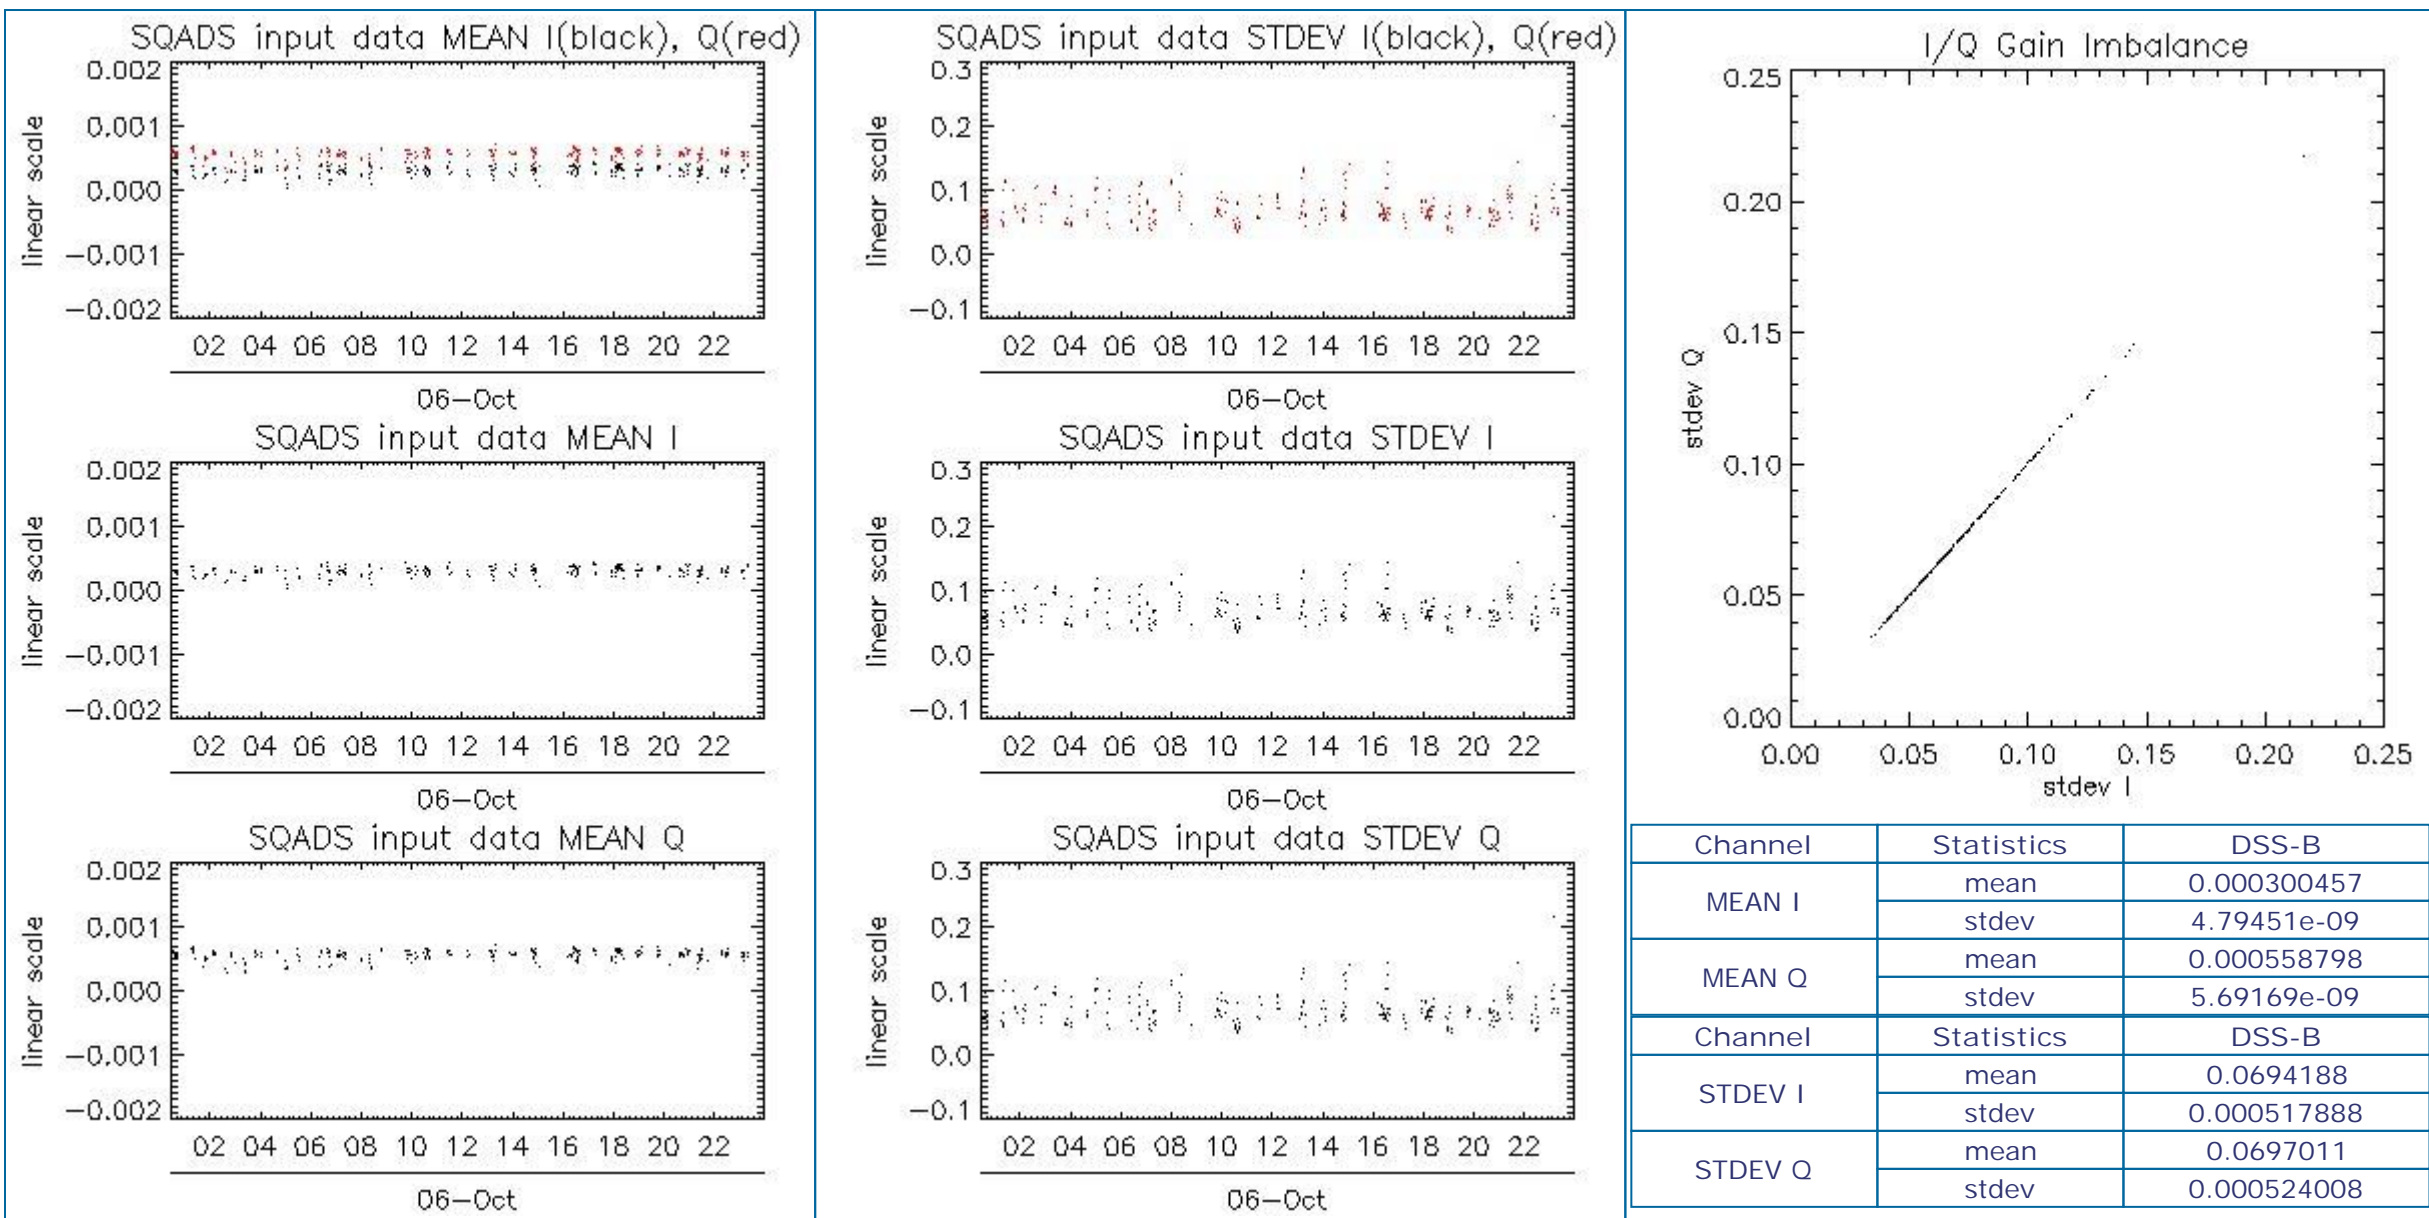



8 - TELEMETRY ANALYSIS

Processing Center	Product	Gaps	Missing lines
PDE	ASA_IMM_1PNPDE20091006_175410_00001262083_00113_39746_8914.N1	1	0
PDE	ASA_IMM_1PNPDE20091006_175410_00000622083_00113_39746_8904.N1	1	0
PDE	ASA_IMM_1PNPDE20091006_201146_00000382083_00114_39747_9025.N1	0	5
PDK	ASA_WSM_1PNPDK20091006_113102_00001342083_00109_39742_7806.N1	5	211

8.1 - Number of Missing lines


[BACK TO MENU]



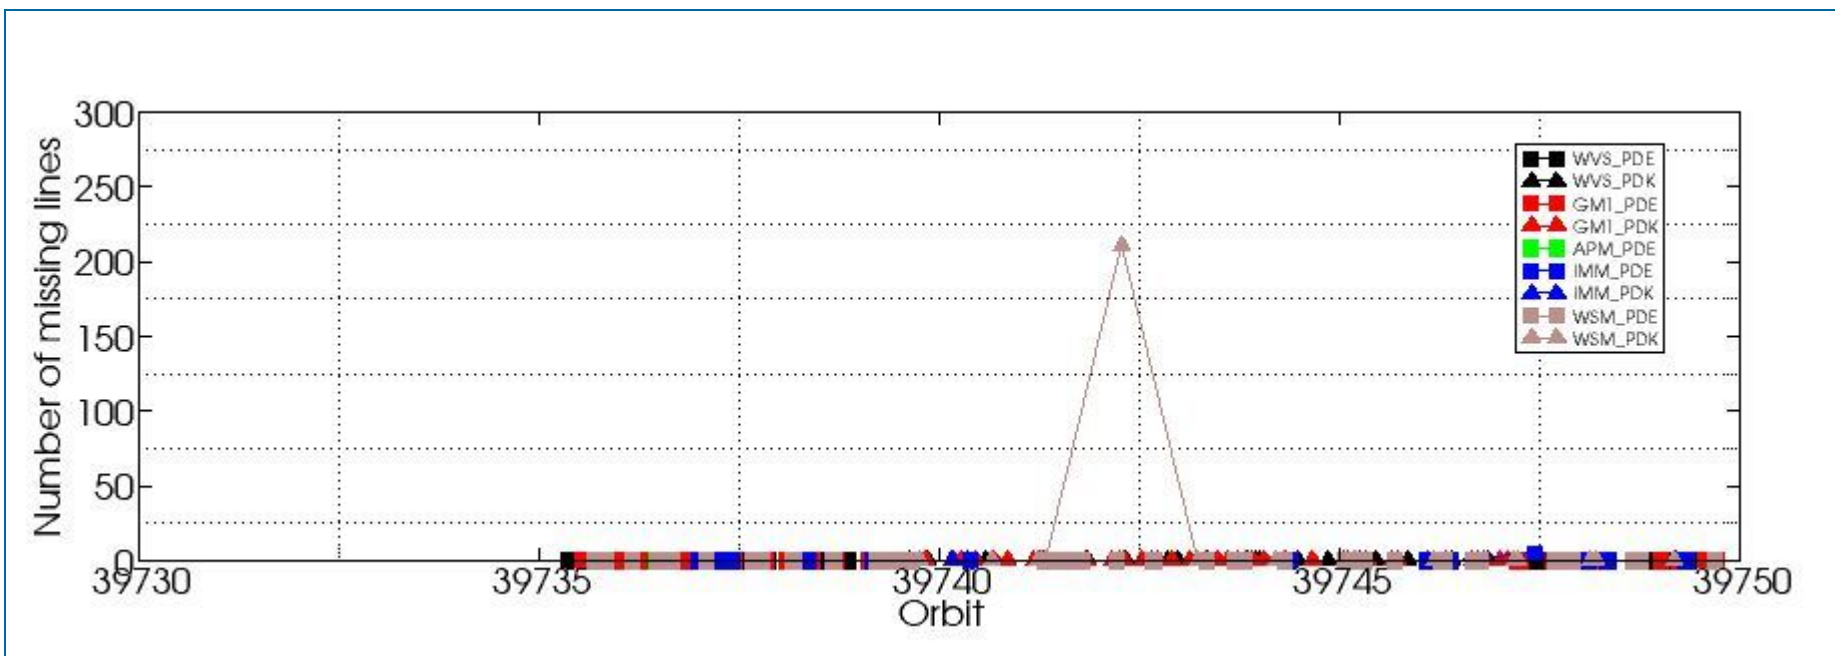

8.2 - Number of Gaps

[[BACK TO MENU](#)]

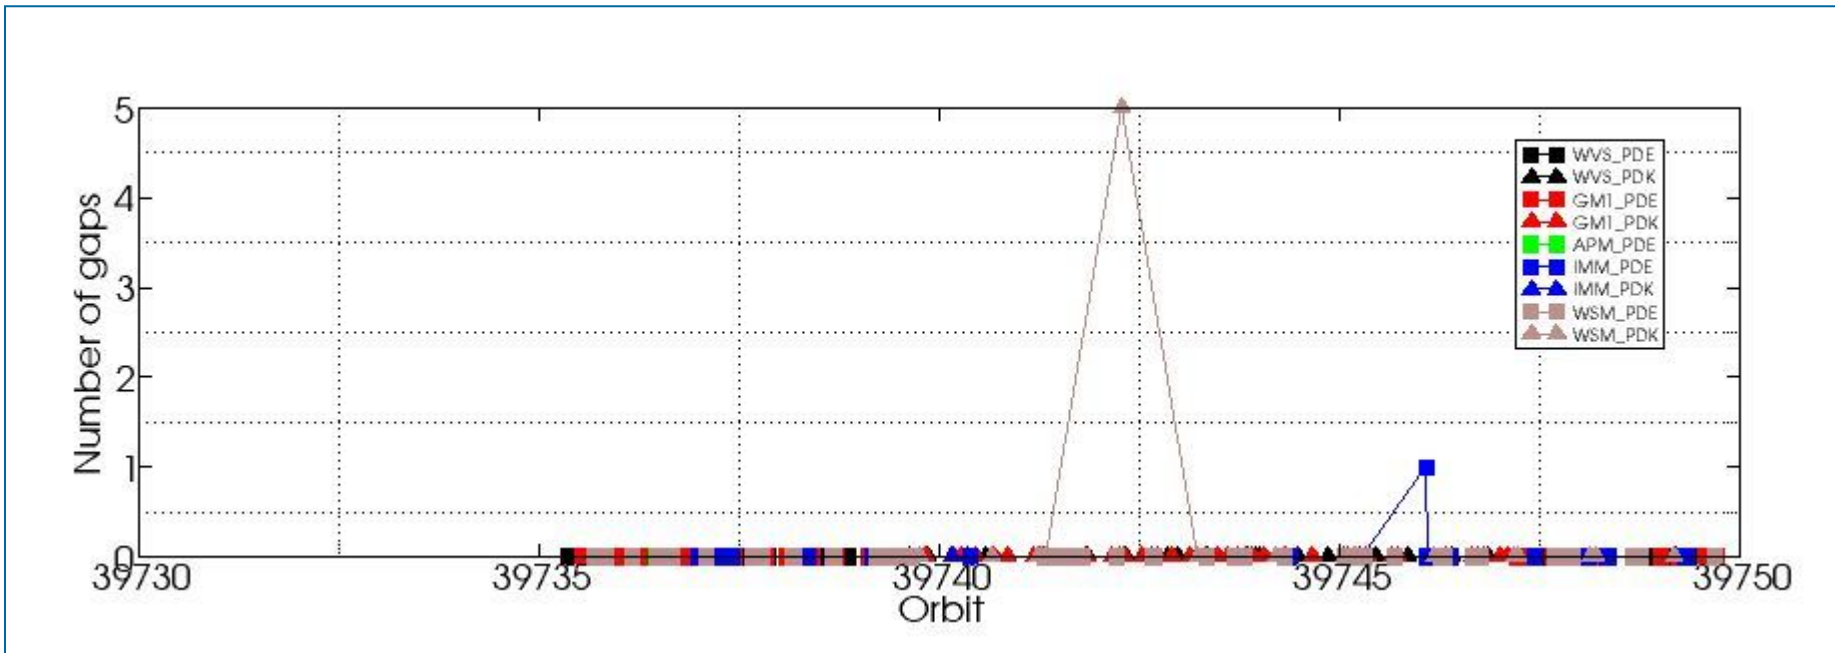

ASAR DAILY REPORT for 091006
#####

MODE: DAILY
ANALYSIS: ALL
DATE: YESTERDAY

Analysis will be performed from 2009-10-06 00:00:00 to 2009-10-06 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/091006/

DATA SUMMARY

Summary will be performed from 2009-10-06 00:00:00 to 2009-10-06 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/091006/DATA_SUMMARY

Creating directory ./RESULTS/DAILY/091006/DATA_SUMMARY...
Writing file ./RESULTS/DAILY/091006/DATA_SUMMARY/Data_summary.html...

Getting WVS products list from 2009-10-06 00:00:00 to 2009-10-06 23:59:59...
Writing file ./RESULTS/DAILY/091006/DATA_SUMMARY/List_WVS_products_used.xls...
Writing file ./RESULTS/DAILY/091006/DATA_SUMMARY/List_WVS_products_used.txt...

Getting GM1 products list from 2009-10-06 00:00:00 to 2009-10-06 23:59:59...
Writing file ./RESULTS/DAILY/091006/DATA_SUMMARY/List_GM1_products_used.xls...
Writing file ./RESULTS/DAILY/091006/DATA_SUMMARY/List_GM1_products_used.txt...

Getting APM products list from 2009-10-06 00:00:00 to 2009-10-06 23:59:59...
Writing file ./RESULTS/DAILY/091006/DATA_SUMMARY/List_APM_products_used.xls...
Writing file ./RESULTS/DAILY/091006/DATA_SUMMARY/List_APM_products_used.txt...

Getting IMM products list from 2009-10-06 00:00:00 to 2009-10-06 23:59:59...
Writing file ./RESULTS/DAILY/091006/DATA_SUMMARY/List_IMM_products_used.xls...
Writing file ./RESULTS/DAILY/091006/DATA_SUMMARY/List_IMM_products_used.txt...

Getting WSM products list from 2009-10-06 00:00:00 to 2009-10-06 23:59:59...
Writing file ./RESULTS/DAILY/091006/DATA_SUMMARY/List_WSM_products_used.xls...
Writing file ./RESULTS/DAILY/091006/DATA_SUMMARY/List_WSM_products_used.txt...

Getting MS products list from 2009-10-06 00:00:00 to 2009-10-06 23:59:59...
Writing file ./RESULTS/DAILY/091006/DATA_SUMMARY/List_MS_products_used.xls...
Writing file ./RESULTS/DAILY/091006/DATA_SUMMARY/List_MS_products_used.txt...

DATA SUMMARY completed
#####

AUXILIARY FILES ANALYSIS

Analysis will be performed from 2009-10-06 00:00:00 to 2009-10-06 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/091006/AUXILIARY

Creating directory ./RESULTS/DAILY/091006/AUXILIARY...

Looking for the IECF operational ADFs list...



ADF filter 20091006*current_3_IECF_ADFs.txt
 Found list 20091006_030001_current_3_IECF_ADFs.txt...
 Extracting ADFs...

ASA_CON_AXVIEC20081215_141339_20070204_165113_20091231_000000
 ASA_INS_AXVIEC20090525_114808_20090428_100000_20091231_235959
 ASA_XCH_AXVIEC20081215_143642_20020301_000000_20091231_000000
 ASA_XCA_AXVIEC20090311_104501_20080801_000000_20091231_235959

Writing file ./RESULTS/DAILY/091006/AUXILIARY/ASAR_ADFs_IECF_List3.html...
 Writing file ./RESULTS/DAILY/091006/AUXILIARY/Auxiliary_files_summary.html...

Analysing WVS products...

Writing file ./RESULTS/DAILY/091006/AUXILIARY/Check_ADFs_WVS.xls...
 Writing file ./RESULTS/DAILY/091006/AUXILIARY/Check_ADFs_WVS.txt...

ASA_WVS_1PNPDE20091006_002009_000003002083_00102_39735_8326.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_004444_000002402083_00102_39735_8334.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_004759_000004192083_00102_39735_8392.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_005949_000009442083_00102_39735_8447.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_014110_000001642083_00103_39736_8400.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_014745_000001192083_00103_39736_8403.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_015206_000002392083_00103_39736_8425.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_015832_000004352083_00103_39736_8415.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_022529_000002402083_00103_39736_8486.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_032717_000008392083_00104_39737_8501.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_034102_000002102083_00104_39737_8539.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_040802_000010042083_00104_39737_8550.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_050727_000009142083_00105_39738_8553.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_052226_000002702083_00105_39738_8639.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_054641_000015292083_00105_39738_8670.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_061415_000000592083_00106_39739_8716.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_065326_000000742083_00106_39739_8730.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_065801_000002842083_00106_39739_8711.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_200047_000006142083_00114_39747_8959.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_201230_000011842083_00114_39747_8968.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_205204_000001502083_00114_39747_9038.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_211759_000000442083_00115_39748_9048.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_214110_000000602083_00115_39748_9045.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_214326_000017692083_00115_39748_9053.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_223313_000002242083_00115_39748_9056.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_223613_000007342083_00115_39748_9102.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_225658_000004492083_00116_39749_9107.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_232316_000011692083_00116_39749_9123.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091006_234941_000002252083_00116_39749_9118.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_070456_000001502083_00106_39739_7675.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_072717_000018142083_00106_39739_7680.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_083949_000004802083_00107_39740_7730.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_090753_000019342083_00107_39740_7745.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_104829_000017542083_00108_39741_7797.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_113625_000011542083_00109_39742_7813.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_115736_000007042083_00109_39742_7820.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_122904_000002702083_00109_39742_7825.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_124039_000009032083_00109_39742_7830.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_131939_000007792083_00110_39743_7870.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_140940_000003152083_00110_39743_7873.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_142012_000001942083_00110_39743_7876.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_142536_000002992083_00111_39744_7881.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_151254_000010492083_00111_39744_7913.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_155016_000012292083_00111_39744_7924.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_165118_000011842083_00112_39745_7963.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_173052_000013042083_00112_39745_7968.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_182630_000015142083_00113_39746_8006.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091006_191128_000008542083_00113_39746_8013.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing GM1 products...

Writing file ./RESULTS/DAILY/091006/AUXILIARY/Check_ADFs_GM1.xls...

Writing file ./RESULTS/DAILY/091006/AUXILIARY/Check_ADFs_GM1.txt...

ASA_GM1_1PNPDE20091006_001311_000004162083_00102_39735_8320.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_002550_000001262083_00102_39735_8318.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_002959_000002952083_00102_39735_8328.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_005539_000002472083_00102_39735_8429.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_012345_000010452083_00103_39736_8481.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_013916_00001142083_00103_39736_8407.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_015650_00001022083_00103_39736_8409.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_021203_000007552083_00103_39736_8417.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_022321_000001262083_00103_39736_8465.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_023005_000004892083_00103_39736_8467.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_023943_000002652083_00103_39736_8469.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_025405_000004652083_00104_39737_8490.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_030239_000011052083_00104_39737_8509.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_032427_000001692083_00104_39737_8498.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_035233_000004412083_00104_39737_8541.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_040334_000002652083_00104_39737_8543.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_043004_000005012083_00105_39738_8545.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_044205_000010152083_00105_39738_8579.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_050331_000002352083_00105_39738_8547.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_053325_000007912083_00105_39738_8661.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_061253_000000782083_00106_39739_8706.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_061603_000002112083_00106_39739_8704.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_062116_000001442083_00106_39739_8708.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_062600_000007852083_00106_39739_8672.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_064900_000002652083_00106_39739_8718.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_065520_000001572083_00106_39739_8713.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_194748_000000962083_00114_39747_8956.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_195304_000004592083_00114_39747_8963.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_203301_000001322083_00114_39747_8961.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_203851_000002592083_00114_39747_8965.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_205027_000000962083_00114_39747_9035.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_210022_000010562083_00114_39747_9062.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_213208_000005372083_00115_39748_9060.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_221337_000000902083_00115_39748_9050.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_221909_000003382083_00115_39748_9058.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_224910_000003742083_00116_39749_9109.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_231146_000004532083_00116_39749_9104.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_234337_000002652083_00116_39749_9113.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_235413_000001142083_00116_39749_9130.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20091006_235837_000000962083_00116_39749_9132.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_072416_000001812083_00106_39739_7677.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_075935_000006702083_00107_39740_7682.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_080933_000004592083_00107_39740_7727.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_082808_000007002083_00107_39740_7732.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_085135_000009732083_00107_39740_7753.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_090706_000000422083_00107_39740_7736.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_094053_000002832083_00108_39741_7738.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_094829_000000782083_00108_39741_7740.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_095238_000000722083_00108_39741_7742.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_104717_000000722083_00108_39741_7788.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_111820_000004282083_00109_39742_7790.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_112824_000001022083_00109_39742_7794.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_112854_000000902083_00109_39742_7808.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_113322_000001812083_00109_39742_7810.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_115623_000000722083_00109_39742_7815.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_121002_000000962083_00109_39742_7817.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_121628_000007552083_00109_39742_7822.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_123423_000003742083_00109_39742_7827.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_125628_000006102083_00110_39743_7832.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

ASA_GM1_1PNPDK20091006_131631_000000782083_00110_39743_7859.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_133317_000006702083_00110_39743_7861.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_134430_000006162083_00110_39743_7863.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_135655_000003862083_00110_39743_7865.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_140701_000001572083_00110_39743_7867.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_141544_000002652083_00110_39743_7878.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_143116_000008822083_00111_39744_7883.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_145719_000003262083_00111_39744_7910.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_153114_000011412083_00111_39744_7926.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_161131_00000902083_00112_39745_7915.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_161508_000003082083_00112_39745_7921.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_163926_000007122083_00112_39745_7958.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_171150_000001022083_00112_39745_7960.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_171831_000007372083_00112_39745_7965.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_175629_000004042083_00113_39746_7970.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_182002_000002412083_00113_39746_7997.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_185226_00000902083_00113_39746_7999.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_185839_000002352083_00113_39746_8001.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_190645_000002832083_00113_39746_8003.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_192625_000005432083_00113_39746_8008.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091006_193735_000003862083_00114_39747_8010.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing APM products...

Writing file ./RESULTS/DAILY/091006/AUXILIARY/Check_ADFs_APM.xls...

Writing file ./RESULTS/DAILY/091006/AUXILIARY/Check_ADFs_APM.txt...

ASA_APM_1PNPDE20091006_014605_000000932083_00103_39736_8507.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20091006_032104_000000912083_00104_39737_8496.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20091006_032208_000000272083_00104_39737_8461.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing IMM products...

Writing file ./RESULTS/DAILY/091006/AUXILIARY/Check_ADFs_IMM.xls...

Writing file ./RESULTS/DAILY/091006/AUXILIARY/Check_ADFs_IMM.txt...

ASA_IMM_1PNPDE20091006_023814_000000792083_00103_39736_8519.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_023918_000000152083_00103_39736_8477.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_030149_000000372083_00104_39737_8503.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_032238_000000982083_00104_39737_8479.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_045858_000002622083_00105_39738_8624.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_061933_000000922083_00106_39739_8626.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_064208_000001562083_00106_39739_8734.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_064746_000000632083_00106_39739_8655.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_082045_000001512083_00107_39740_8746.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_150246_000000352083_00111_39744_8854.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_163223_000001412083_00112_39745_8894.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_175410_000000622083_00113_39746_8904.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_175410_000001262083_00113_39746_8914.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_175612_000000052083_00113_39746_8908.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_182405_000000432083_00113_39746_8928.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_182531_000000532083_00113_39746_8930.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_201146_000000382083_00114_39747_9025.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_211940_000000302083_00115_39748_9066.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_214242_000000392083_00115_39748_9068.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_231917_000001382083_00116_39749_9151.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091006_232120_000000152083_00116_39749_9140.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20091006_075803_000000802083_00107_39740_7694.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20091006_081711_000001482083_00107_39740_7713.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20091006_145500_000000372083_00111_39744_7885.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20091006_163118_000000922083_00112_39745_7946.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20091006_230805_000002102083_00116_39749_8076.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing WSM products...

Writing file ./RESULTS/DAILY/091006/AUXILIARY/Check_ADFs_WSM.xls...

Writing file ./RESULTS/DAILY/091006/AUXILIARY/Check_ADFs_WSM.txt...

ASA_WSM_1PNPDE20091006_002801_000001152083_00102_39735_8336.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_003458_000002502083_00102_39735_8488.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_003458_000005742083_00102_39735_8532.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_004307_000000612083_00102_39735_8383.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_011652_000004092083_00103_39736_8766.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_015035_000000912083_00103_39736_8591.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_020727_000002752083_00103_39736_8463.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_024848_000002192083_00104_39737_8569.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_034739_000000732083_00104_39737_8608.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_034739_000002872083_00104_39737_8764.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_034954_000001512083_00104_39737_8653.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_035150_000000362083_00104_39737_8589.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_035958_000002142083_00104_39737_8596.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_043829_000002142083_00105_39738_8697.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_044044_000000792083_00105_39738_8651.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_052849_000000732083_00105_39738_8598.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_052849_000002692083_00105_39738_8762.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_053104_000001332083_00105_39738_8622.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_062345_000001292083_00106_39739_8687.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_063908_000001532083_00106_39739_8736.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_064512_000000982083_00106_39739_8744.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_070326_000000922083_00106_39739_8699.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_070804_000002142083_00106_39739_8732.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_095521_000000732083_00108_39741_8768.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_100927_000001472083_00108_39741_8780.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_102933_000000922083_00108_39741_8782.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_103134_000004342083_00108_39741_8808.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_103824_000001772083_00108_39741_8832.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_104039_000000422083_00108_39741_8830.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_104201_000000982083_00108_39741_8810.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_112531_000001712083_00109_39742_8822.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_121142_000002802083_00109_39742_8824.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_131753_000001092083_00110_39743_8860.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_135450_000001212083_00110_39743_8862.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_140326_000000912083_00110_39743_8882.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_140527_000000912083_00110_39743_8864.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_145545_000000912083_00111_39744_8884.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_161308_000001152083_00112_39745_8874.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_162017_000002382083_00112_39745_8880.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_163454_000002512083_00112_39745_8916.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_163607_000000612083_00112_39745_8898.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_163804_000000612083_00112_39745_8902.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_171338_000002872083_00112_39745_9023.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_181323_000001212083_00113_39746_8926.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_181411_000001902083_00113_39746_9027.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_181411_000003482083_00113_39746_9033.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_181822_000000962083_00113_39746_9028.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_185403_000002692083_00113_39746_8989.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_190241_000002382083_00113_39746_8954.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_203516_000001892083_00114_39747_9064.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_203516_000002072083_00114_39747_9070.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_204317_000001342083_00114_39747_9021.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_204317_000001702083_00114_39747_9031.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_204622_000002442083_00114_39747_9095.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_204735_000001702083_00114_39747_9075.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_205523_000002932083_00114_39747_9093.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_205737_000000552083_00114_39747_9013.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_221512_000002312083_00115_39748_9264.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_221726_000000972083_00115_39748_9238.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK


```
ASA_WSM_1PNPDE20091006_222453_000003122083_00115_39748_9149.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_222453_000004892083_00115_39748_9211.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20091006_235612_000001352083_00116_39749_9153.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_071719_000004162083_00106_39739_7723.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_084826_000000972083_00107_39740_7776.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_094712_000000612083_00108_39741_7761.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_094953_000001592083_00108_39741_7774.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_095657_000002142083_00108_39741_7778.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_095657_000002142083_00108_39741_7792.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_113102_000001342083_00109_39742_7806.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_130641_000005872083_00110_39743_7857.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_144559_000004342083_00111_39744_7908.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_144559_000005372083_00111_39744_8032.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_145408_000000482083_00111_39744_7906.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_162345_000001532083_00112_39745_7954.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_162641_000002512083_00112_39745_7956.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_180317_000005872083_00113_39746_7995.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_194407_000002202083_00114_39747_8034.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_194932_000001892083_00114_39747_8036.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_212055_000003052083_00115_39748_8058.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_212649_000003122083_00115_39748_8060.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091006_230505_000001702083_00116_39749_8078.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

AUXILIARY FILES ANALYSIS completed

#####

MODULE STEPPING ANALYSIS

#####

Analysis will be performed from 2009-10-06 00:00:00 to 2009-10-06 23:59:59

Results will be exported to the directory: ./RESULTS/DAILY/091006/MODULE_STEPPING

Creating directory ./RESULTS/DAILY/091006/MODULE_STEPPING...

Creating directory ./RESULTS/DAILY/091006/MODULE_STEPPING/FIRST_REFERENCE...

Creating directory ./RESULTS/DAILY/091006/MODULE_STEPPING/SECOND_REFERENCE...

Creating directory ./RESULTS/DAILY/091006/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Deleting old files...

Creating images comparing with second reference...

Exporting results to the directory ../../RESULTS/DAILY/091006/MODULE_STEPPING/SECOND_REFERENCE...

Polarization: H

Reference product: ASA_MS_0PNPDK20050922_062651_00000152041_00034_18625_0041.N1

Test product: ASA_MS_0PNPDK20091005_092154_00000162083_00093_39726_0890.N1

H

H

../../RESULTS/DAILY/091006/MODULE_STEPPING/SECOND_REFERENCE/TGH_20091005_092154-20050922_062651.png

../../RESULTS/DAILY/091006/MODULE_STEPPING/SECOND_REFERENCE/TPH_20091005_092154-20050922_062651.png

../../RESULTS/DAILY/091006/MODULE_STEPPING/SECOND_REFERENCE/RGH_20091005_092154-20050922_062651.png

../../RESULTS/DAILY/091006/MODULE_STEPPING/SECOND_REFERENCE/RPH_20091005_092154-20050922_062651.png

Polarization: V

Reference product: ASA_MS_0PNPDK20050923_055514_00000152041_00048_18639_0042.N1

Test product: ASA_MS_0PNPDK20091006_085017_00000162083_00107_39740_0891.N1

V

V

../../RESULTS/DAILY/091006/MODULE_STEPPING/SECOND_REFERENCE/TGV_20091006_085017-20050923_055514.png

../../RESULTS/DAILY/091006/MODULE_STEPPING/SECOND_REFERENCE/TPV_20091006_085017-20050923_055514.png

../../RESULTS/DAILY/091006/MODULE_STEPPING/SECOND_REFERENCE/RGV_20091006_085017-20050923_055514.png

../../RESULTS/DAILY/091006/MODULE_STEPPING/SECOND_REFERENCE/RPV_20091006_085017-20050923_055514.png

Creating images comparing with previous product reference...

Exporting results to the directory ../../RESULTS/DAILY/091006/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Polarization: H

Reference product: ASA_MS__0PNPDK20091003_084432_000000162083_00064_39697_0888.N1

Test product: ASA_MS__0PNPDK20091005_092154_000000162083_00093_39726_0890.N1

H
H

../../RESULTS/DAILY/091006/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGH_20091005_092154-20091003_084432.png
../../RESULTS/DAILY/091006/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPH_20091005_092154-20091003_084432.png
../../RESULTS/DAILY/091006/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGH_20091005_092154-20091003_084432.png
../../RESULTS/DAILY/091006/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPH_20091005_092154-20091003_084432.png

Polarization: V

Reference product: ASA_MS__0PNPDK20091004_095331_000000162083_00079_39712_0889.N1

Test product: ASA_MS__0PNPDK20091006_085017_000000162083_00107_39740_0891.N1

V
V

../../RESULTS/DAILY/091006/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGV_20091006_085017-20091004_095331.png
../../RESULTS/DAILY/091006/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPV_20091006_085017-20091004_095331.png
../../RESULTS/DAILY/091006/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGV_20091006_085017-20091004_095331.png
../../RESULTS/DAILY/091006/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPV_20091006_085017-20091004_095331.png

MODULE_STEPPING ANALYSIS completed

#####

CALIBRATION PULSES ANALYSIS

#####

Creating directory ./RESULTS/DAILY/091006/CALIBRATION_PULSES...

ALL ROWS Analysis will be performed from 2009-10-06 00:00:00 to 2009-10-06 23:59:59

Analysing products WVS IS2 V/V

Writing image ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Calibration_pulses_all_rows_WVS_IS2_VV.png...

Analysing products GM1 SS3 H/H

Writing image ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Calibration_pulses_all_rows_GM1_SS3_HH.png...

TEMPORAL EVOLUTION Analysis will be performed from 2009-10-06 00:00:00 to 2009-10-06 23:59:59

Analysing products WVS IS2 V/V

Getting calibration pulses data for WVS IS2 V/V from 2009-10-06 00:00:00 to 2009-10-06 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/091006/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-10-06_1.dat...

Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_1.png...

Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2009-10-06 00:00:00 to 2009-10-06 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/091006/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-10-06_2.dat...

Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_2.png...

Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2009-10-06 00:00:00 to 2009-10-06 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/091006/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-10-06_3.dat...

Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_3.png...

Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2009-10-06 00:00:00 to 2009-10-06 23:59:59. Rows: 4/8/12/16/20/24/28/32
Writing file ./RESULTS/DAILY/091006/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-10-06_4.dat...
Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_4.png...
Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_4.png...

Analysing products GM1 SS3 H/H
Getting calibration pulses data for GM1 SS3 H/H from 2009-10-06 00:00:00 to 2009-10-06 23:59:59. Rows: 1/5/9/13/17/21/25/29
Writing file ./RESULTS/DAILY/091006/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-10-06_1.dat...
Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_1.png...
Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_1.png...

Getting calibration pulses data for GM1 SS3 H/H from 2009-10-06 00:00:00 to 2009-10-06 23:59:59. Rows: 2/6/10/14/18/22/26/30
Writing file ./RESULTS/DAILY/091006/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-10-06_2.dat...
Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_2.png...
Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2009-10-06 00:00:00 to 2009-10-06 23:59:59. Rows: 3/7/11/15/19/23/27/31
Writing file ./RESULTS/DAILY/091006/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-10-06_3.dat...
Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_3.png...
Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2009-10-06 00:00:00 to 2009-10-06 23:59:59. Rows: 4/8/12/16/20/24/28/32
Writing file ./RESULTS/DAILY/091006/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-10-06_4.dat...
Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_4.png...
Writing ../../RESULTS/DAILY/091006//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_4.png...

CALIBRATION PULSES ANALYSIS completed
#####

DOPPLER ANALYSIS

Creating directory ./RESULTS/DAILY/091006/DOPPLER...

DOPPLER ANX Analysis will be performed from 2009-10-06 00:00:00 to 2009-10-06 23:59:59

Analysing products WVS IS2 V/V
Getting doppler data for WVS IS2 V/V from 2009-10-06 00:00:00 to 2009-10-06 23:59:59...
Writing file ./RESULTS/DAILY/091006/DOPPLER/Doppler_data_WVS_IS2_VV_2009-10-06.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/091006/DOPPLER/DOPPLER_ANX_WVS_IS2_VV.png...

Analysing products GM1 SS1 H/H
Getting doppler data for GM1 SS1 H/H from 2009-10-06 00:00:00 to 2009-10-06 23:59:59...
Writing file ./RESULTS/DAILY/091006/DOPPLER/Doppler_data_GM1_SS1_HH_2009-10-06.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/091006/DOPPLER/DOPPLER_ANX_GM1_SS1_HH.png...

DOPPLER JUMPS Analysis will be performed on WSM products from 2009-10-06 00:00:00 to 2009-10-06 23:59:59

Analysing by default products WSM
Getting doppler jumps data for WSM from 2009-10-06 00:00:00 to 2009-10-06 23:59:59...



Writing file ./RESULTS/DAILY/091006/DOPPLER/Doppler_Jumps_data_WSM_2009-10-06.dat...
Running IDL program...
Writing file ../RESULTS/DAILY/091006/DOPPLER/DOPPLER_JUMPS_ANX_WSM.png...
Writing file ../RESULTS/DAILY/091006/DOPPLER/DOPPLER_JUMPS_Date_WSM.png...

DOPPLER MAP Analysis will be performed from 2009-10-06 00:00:00 to 2009-10-06 23:59:59

Analysing products WVS IS2 V/V
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -35.962622 Hz
Writing file ../RESULTS/DAILY/091006//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_desc.jpg...
Writing file ../RESULTS/DAILY/091006//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_desc.jpg...

Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -34.159256 Hz
Writing file ../RESULTS/DAILY/091006//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_asc.jpg...
Writing file ../RESULTS/DAILY/091006//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_asc.jpg...

Analysing products GM1 SS1 H/H
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -22.714068 Hz
Writing file ../RESULTS/DAILY/091006//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_desc.jpg...
Writing file ../RESULTS/DAILY/091006//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_desc.jpg...

Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -33.198291 Hz
Writing file ../RESULTS/DAILY/091006//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_asc.jpg...
Writing file ../RESULTS/DAILY/091006//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_asc.jpg...

DOPPLER ANALYSIS completed
#####

CHIRP ANALYSIS

Creating directory ./RESULTS/DAILY/091006/CHIRP...

CHIRP Analysis will be performed from 2009-10-06 00:00:00 to 2009-10-06 23:59:59

Analysing products WSM SS1 H/H

```
*****
Getting ScaleFactor data for WSM SS1 H/H from 2009-10-06 00:00:00 to 2009-10-06 23:59:59...
Writing file ./RESULTS/DAILY/091006/CHIRP/ScaleFactor_data_WSM_SS1_HH_2009-10-06.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/091006/CHIRP/ScaleFactor_ANX_WSM_SS1_HH.png...
Writing file ../../RESULTS/DAILY/091006/CHIRP/ScaleFactor_DATE_WSM_SS1_HH.png...
```

```
Analysing products WSM SS1 V/V
*****
Getting ScaleFactor data for WSM SS1 V/V from 2009-10-06 00:00:00 to 2009-10-06 23:59:59...
Writing file ./RESULTS/DAILY/091006/CHIRP/ScaleFactor_data_WSM_SS1_VV_2009-10-06.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/091006/CHIRP/ScaleFactor_ANX_WSM_SS1_VV.png...
Writing file ../../RESULTS/DAILY/091006/CHIRP/ScaleFactor_DATE_WSM_SS1_VV.png...
```

```
CHIRP ANALYSIS completed
#####
```

```
RAW DATA ANALYSIS
#####
Analysis will be performed from 2009-10-06 00:00:00 to 2009-10-06 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/091006/RAW_DATA
```

```
Creating directory ./RESULTS/DAILY/091006/RAW_DATA...
```

```
*****
Getting raw data for WVS from 2009-10-06 00:00:00 to 2009-10-06 23:59:59...
Writing file ./RESULTS/DAILY/091006/RAW_DATA/Raw_data_WVS_2009-10-06.dat...
Running IDL program to create graphs...
```

```
Creating image ../../RESULTS/DAILY/091006/RAW_DATA/Raw_data_WVS_input_mean.png...
Creating image ../../RESULTS/DAILY/091006/RAW_DATA/Raw_data_WVS_input_stdev.png...
Creating image ../../RESULTS/DAILY/091006/RAW_DATA/Raw_data_WVS_gain_imbalance.png...
```

```
*****
Getting raw data for IMM from 2009-10-06 00:00:00 to 2009-10-06 23:59:59...
Writing file ./RESULTS/DAILY/091006/RAW_DATA/Raw_data_IMM_2009-10-06.dat...
Running IDL program to create graphs...
```

```
Creating image ../../RESULTS/DAILY/091006/RAW_DATA/Raw_data_IMM_input_mean.png...
Creating image ../../RESULTS/DAILY/091006/RAW_DATA/Raw_data_IMM_input_stdev.png...
Creating image ../../RESULTS/DAILY/091006/RAW_DATA/Raw_data_IMM_gain_imbalance.png...
```

```
RAW DATA ANALYSIS completed
#####
```

```
TELEMETRY ANALYSIS
#####
Analysis will be performed from 2009-10-06 00:00:00 to 2009-10-06 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/091006/TELEMETRY
```

```
Creating directory ./RESULTS/DAILY/091006/TELEMETRY...
```

```
Looking for gaps and missing lines in WVS products...
*****
Checking 30 products from PDE...
Checking 19 products from PDK...
```

```
Looking for gaps and missing lines in GM1 products...
*****
Checking 40 products from PDE...
```

Checking 40 products from PDK...

Looking for gaps and missing lines in APM products...

Checking 3 products from PDE...

No products from PDK...

Looking for gaps and missing lines in IMM products...

Checking 21 products from PDE...

Found product...ASA_IMM_1PNPDE20091006_175410_000001262083_00113_39746_8914.N1 / 1 gaps / 0 missing lines

Found product...ASA_IMM_1PNPDE20091006_175410_00000622083_00113_39746_8904.N1 / 1 gaps / 0 missing lines

Found product...ASA_IMM_1PNPDE20091006_201146_00000382083_00114_39747_9025.N1 / 0 gaps / 5 missing lines

Checking 5 products from PDK...

Looking for gaps and missing lines in WSM products...

Checking 62 products from PDE...

Checking 19 products from PDK...

Found product...ASA_WSM_1PNPDK20091006_113102_000001342083_00109_39742_7806.N1 / 5 gaps / 211 missing lines

Creating graph of missing lines and gaps...

Creating image: ./RESULTS/DAILY/091006/TELEMETRY/TELEMETRY_Missing_lines.png...

Creating image: ./RESULTS/DAILY/091006/TELEMETRY/TELEMETRY_Gaps.png...

TELEMETRY ANALYSIS completed

#####

BROWSE PRODUCTS ANALYSIS

#####

Analysis will be performed on 2009-10-06

Scanning directory /nfs-store/ASAR_Data//ASA_GM_BP...

Results will be exported to the directory: /nfs-store/ASAR_Data//ASA_GM_BP/JPG/20091006/

ANALYSIS COMPLETED: 0 GM browse products to see...

Scanning directory /nfs-store/ASAR_Data//ASA_AP_BP...

Results will be exported to the directory: /nfs-store/ASAR_Data//ASA_AP_BP/JPG/20091006/

ANALYSIS COMPLETED: 0 AP browse products to see...

Scanning directory /nfs-store/ASAR_Data//ASA_IM_BP...

Results will be exported to the directory: /nfs-store/ASAR_Data//ASA_IM_BP/JPG/20091006/

ANALYSIS COMPLETED: 0 IM browse products to see...

Scanning directory /nfs-store/ASAR_Data//ASA_WS_BP...

Results will be exported to the directory: /nfs-store/ASAR_Data//ASA_WS_BP/JPG/20091006/

ANALYSIS COMPLETED: 0 WS browse products to see...

BROWSE PRODUCTS ANALYSIS completed

#####

HTML REPORT generation

#####

Building file ./RESULTS/DAILY/091006/asarReport.html...

Building DATA SUMMARY section...

Building AUXILIARY FILES ANALYSIS section...

Building MODULE STEPPING ANALYSIS section...

Building CALIBRATION PULSES ANALYSIS section...

Building DOPPLER ANALYSIS section...

Building CHIRP ANALYSIS section...

Building RAW DATA ANALYSIS section...

Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed

#####



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20091006_014605_000000932083_00103_39736_8507.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20091006_032104_000000912083_00104_39737_8496.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20091006_032208_000000272083_00104_39737_8461.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20091006_001311_000004162083_00102_39735_8320.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_002550_000001262083_00102_39735_8318.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_002959_000002952083_00102_39735_8328.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_005539_000002472083_00102_39735_8429.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_012345_000010452083_00103_39736_8481.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_013916_000001142083_00103_39736_8407.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_015650_000001022083_00103_39736_8409.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_021203_000007552083_00103_39736_8417.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_022321_000001262083_00103_39736_8465.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_023005_000004892083_00103_39736_8467.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_023943_000002652083_00103_39736_8469.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_025405_000004652083_00104_39737_8490.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_030239_000011052083_00104_39737_8509.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_032427_000001692083_00104_39737_8498.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_035233_000004412083_00104_39737_8541.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_040334_000002652083_00104_39737_8543.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_043004_000005012083_00105_39738_8545.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_044205_000010152083_00105_39738_8579.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_050331_000002352083_00105_39738_8547.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_053325_000007912083_00105_39738_8661.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_061253_000000782083_00106_39739_8706.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_061603_000002112083_00106_39739_8704.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_062116_000001442083_00106_39739_8708.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_062600_000007852083_00106_39739_8672.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_064900_000002652083_00106_39739_8718.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_065520_000001572083_00106_39739_8713.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_194748_000000962083_00114_39747_8956.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_195304_000004592083_00114_39747_8963.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_203301_000001322083_00114_39747_8961.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_203851_000002592083_00114_39747_8965.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_205027_000000962083_00114_39747_9035.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_210022_000010562083_00114_39747_9062.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_213208_000005372083_00115_39748_9060.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_221337_000000902083_00115_39748_9050.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_221909_000003382083_00115_39748_9058.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_224910_000003742083_00116_39749_9109.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_231146_000004532083_00116_39749_9104.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_234337_000002652083_00116_39749_9113.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_235413_000001142083_00116_39749_9130.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091006_235837_000000962083_00116_39749_9132.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_072416_000001812083_00106_39739_7677.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_075935_000006702083_00107_39740_7682.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_080933_000004592083_00107_39740_7727.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_082808_000007002083_00107_39740_7732.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_085135_000009732083_00107_39740_7753.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_090706_000000422083_00107_39740_7736.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_094053_000002832083_00108_39741_7738.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_094829_000000782083_00108_39741_7740.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_095238_000000722083_00108_39741_7742.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_104717_000000722083_00108_39741_7788.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_111820_000004282083_00109_39742_7790.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_112824_000001022083_00109_39742_7794.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_112854_000000902083_00109_39742_7808.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_113322_000001812083_00109_39742_7810.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_115623_000000722083_00109_39742_7815.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_121002_000000962083_00109_39742_7817.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_121628_000007552083_00109_39742_7822.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_123423_000003742083_00109_39742_7827.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_125628_000006102083_00110_39743_7832.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_131631_000000782083_00110_39743_7859.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_133317_000006702083_00110_39743_7861.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_134430_000006162083_00110_39743_7863.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_135655_000003862083_00110_39743_7865.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_140701_000001572083_00110_39743_7867.N1					OK	OK	OK	OK

ASA_GM1_1PNPDK20091006_141544_000002652083_00110_39743_7878.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_143116_000008822083_00111_39744_7883.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_145719_000003262083_00111_39744_7910.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_153114_000011412083_00111_39744_7926.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_161131_000000902083_00112_39745_7915.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_161508_000003082083_00112_39745_7921.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_163926_000007122083_00112_39745_7958.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_171150_000001022083_00112_39745_7960.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_171831_000007372083_00112_39745_7965.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_175629_000004042083_00113_39746_7970.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_182002_000002412083_00113_39746_7997.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_185226_000000902083_00113_39746_7999.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_185839_000002352083_00113_39746_8001.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_190645_000002832083_00113_39746_8003.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_192625_000005432083_00113_39746_8008.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091006_193735_000003862083_00114_39747_8010.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_IMM_1PNPDE20091006_023814_000000792083_00103_39736_8519.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_023918_000000152083_00103_39736_8477.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_030149_000000372083_00104_39737_8503.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_032238_000000982083_00104_39737_8479.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_045858_000002622083_00105_39738_8624.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_061933_000000922083_00106_39739_8626.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_064208_000001562083_00106_39739_8734.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_064746_000000632083_00106_39739_8655.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_082045_000001512083_00107_39740_8746.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_150246_000000352083_00111_39744_8854.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_163223_000001412083_00112_39745_8894.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_175410_000000622083_00113_39746_8904.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_175410_000001262083_00113_39746_8914.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_175612_000000052083_00113_39746_8908.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_182405_000000432083_00113_39746_8928.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_182531_000000532083_00113_39746_8930.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_201146_000000382083_00114_39747_9025.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_211940_000000302083_00115_39748_9066.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_214242_000000392083_00115_39748_9068.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_231917_000001382083_00116_39749_9151.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091006_232120_000000152083_00116_39749_9140.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20091006_075803_000000802083_00107_39740_7694.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20091006_081711_000001482083_00107_39740_7713.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20091006_145500_000000372083_00111_39744_7885.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20091006_163118_000000922083_00112_39745_7946.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20091006_230805_000002102083_00116_39749_8076.N1					OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.


Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WSM_1PNPDE20091006_002801_000001152083_00102_39735_8336.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_003458_000002502083_00102_39735_8488.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_003458_000005742083_00102_39735_8532.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_004307_000000612083_00102_39735_8383.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_011652_000004092083_00103_39736_8766.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_015035_000000912083_00103_39736_8591.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_020727_000002752083_00103_39736_8463.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_024848_000002192083_00104_39737_8569.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_034739_000000732083_00104_39737_8608.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_034739_000002872083_00104_39737_8764.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_034954_000001512083_00104_39737_8653.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_035150_000000362083_00104_39737_8589.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_035958_000002142083_00104_39737_8596.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_043829_000002142083_00105_39738_8697.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_044044_000000792083_00105_39738_8651.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_052849_000000732083_00105_39738_8598.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_052849_000002692083_00105_39738_8762.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_053104_000001332083_00105_39738_8622.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_062345_000001292083_00106_39739_8687.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_063908_000001532083_00106_39739_8736.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_064512_000000982083_00106_39739_8744.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_070326_000000922083_00106_39739_8699.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_070804_000002142083_00106_39739_8732.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_095521_000000732083_00108_39741_8768.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_100927_000001472083_00108_39741_8780.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_102933_000000922083_00108_39741_8782.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_103134_000004342083_00108_39741_8808.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_103824_000001772083_00108_39741_8832.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_104039_000000422083_00108_39741_8830.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_104201_000000982083_00108_39741_8810.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_112531_000001712083_00109_39742_8822.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_121142_000002802083_00109_39742_8824.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_131753_000001092083_00110_39743_8860.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_135450_000001212083_00110_39743_8862.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_140326_000000912083_00110_39743_8882.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_140527_000000912083_00110_39743_8864.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_145545_000000912083_00111_39744_8884.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_161308_000001152083_00112_39745_8874.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_162017_000002382083_00112_39745_8880.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_163454_000002512083_00112_39745_8916.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_163607_000000612083_00112_39745_8898.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_163804_000000612083_00112_39745_8902.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_171338_000002872083_00112_39745_9023.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_181323_000001212083_00113_39746_8926.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_181411_000001902083_00113_39746_9027.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_181411_000003482083_00113_39746_9033.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_181822_000000962083_00113_39746_9028.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_185403_000002692083_00113_39746_8989.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_190241_000002382083_00113_39746_8954.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_203516_000001892083_00114_39747_9064.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_203516_000002072083_00114_39747_9070.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_204317_000001342083_00114_39747_9021.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_204317_000001702083_00114_39747_9031.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_204622_000002442083_00114_39747_9095.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_204735_000001702083_00114_39747_9075.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_205523_000002932083_00114_39747_9093.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_205737_000000552083_00114_39747_9013.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_221512_000002312083_00115_39748_9264.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_221726_000000972083_00115_39748_9238.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_222453_000003122083_00115_39748_9149.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_222453_000004892083_00115_39748_9211.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091006_235612_000001352083_00116_39749_9153.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_071719_000004162083_00106_39739_7723.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_084826_000000972083_00107_39740_7776.N1					OK	OK	OK	OK

ASA_WSM_1PNPDK20091006_094712_000000612083_00108_39741_7761.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_094953_000001592083_00108_39741_7774.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_095657_000002142083_00108_39741_7778.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_095657_000002142083_00108_39741_7792.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_113102_000001342083_00109_39742_7806.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_130641_000005872083_00110_39743_7857.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_144559_000004342083_00111_39744_7908.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_144559_000005372083_00111_39744_8032.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_145408_000000482083_00111_39744_7906.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_162345_000001532083_00112_39745_7954.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_162641_000002512083_00112_39745_7956.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_180317_000005872083_00113_39746_7995.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_194407_000002202083_00114_39747_8034.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_194932_000001892083_00114_39747_8036.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_212055_000003052083_00115_39748_8058.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_212649_000003122083_00115_39748_8060.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091006_230505_000001702083_00116_39749_8078.N1	OK	OK	OK	OK





Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20091006_002009_000003002083_00102_39735_8326.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_004444_000002402083_00102_39735_8334.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_004759_000004192083_00102_39735_8392.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_005949_000009442083_00102_39735_8447.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_014110_000001642083_00103_39736_8400.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_014745_000001192083_00103_39736_8403.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_015206_000002392083_00103_39736_8425.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_015832_000004352083_00103_39736_8415.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_022529_000002402083_00103_39736_8486.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_032717_000008392083_00104_39737_8501.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_034102_000002102083_00104_39737_8539.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_040802_000010042083_00104_39737_8550.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_050727_000009142083_00105_39738_8553.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_052226_000002702083_00105_39738_8639.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_054641_000015292083_00105_39738_8670.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_061415_000000592083_00106_39739_8716.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_065326_000000742083_00106_39739_8730.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_065801_000002842083_00106_39739_8711.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_200047_000006142083_00114_39747_8959.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_201230_000011842083_00114_39747_8968.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_205204_000001502083_00114_39747_9038.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_211759_000000442083_00115_39748_9048.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_214110_000000602083_00115_39748_9045.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_214326_000017692083_00115_39748_9053.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_223313_000002242083_00115_39748_9056.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_223613_000007342083_00115_39748_9102.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_225658_000004492083_00116_39749_9107.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_232316_000011692083_00116_39749_9123.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091006_234941_000002252083_00116_39749_9118.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_070456_000001502083_00106_39739_7675.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_072717_000018142083_00106_39739_7680.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_083949_000004802083_00107_39740_7730.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_090753_000019342083_00107_39740_7745.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_104829_000017542083_00108_39741_7797.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_113625_000011542083_00109_39742_7813.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_115736_000007042083_00109_39742_7820.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_122904_000002702083_00109_39742_7825.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_124039_000009032083_00109_39742_7830.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_131939_000007792083_00110_39743_7870.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_140940_000003152083_00110_39743_7873.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_142012_000001942083_00110_39743_7876.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_142536_000002992083_00111_39744_7881.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_151254_000010492083_00111_39744_7913.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_155016_000012292083_00111_39744_7924.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_165118_000011842083_00112_39745_7963.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_173052_000013042083_00112_39745_7968.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_182630_000015142083_00113_39746_8006.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091006_191128_000008542083_00113_39746_8013.N1					OK	OK	OK	OK

Calibration pulses for GM1 SS3 H/H




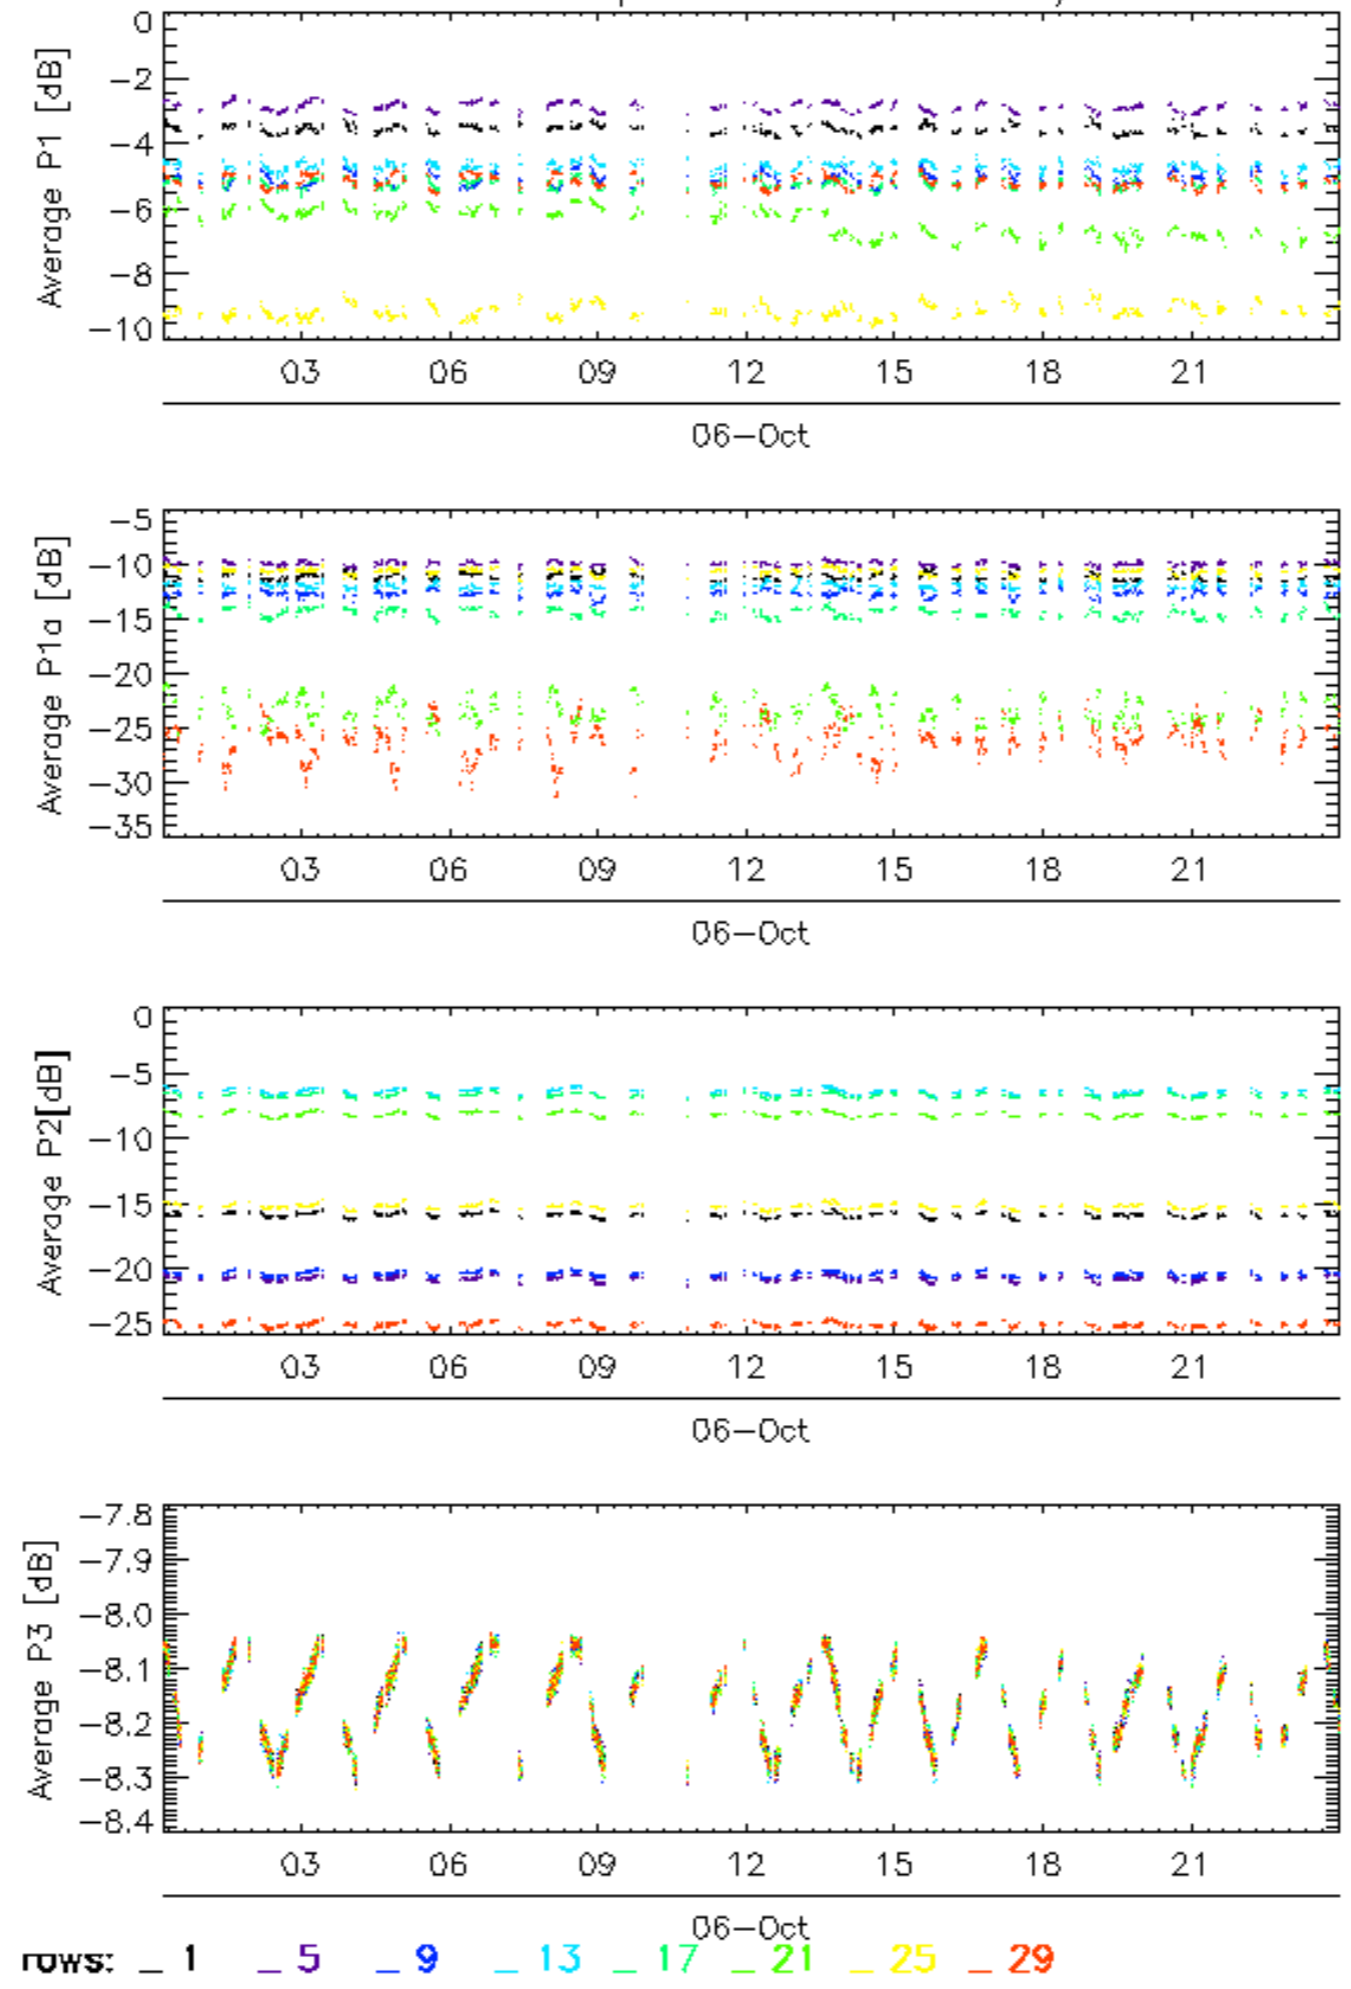


Calibration pulses for GM1 SS3 H/H

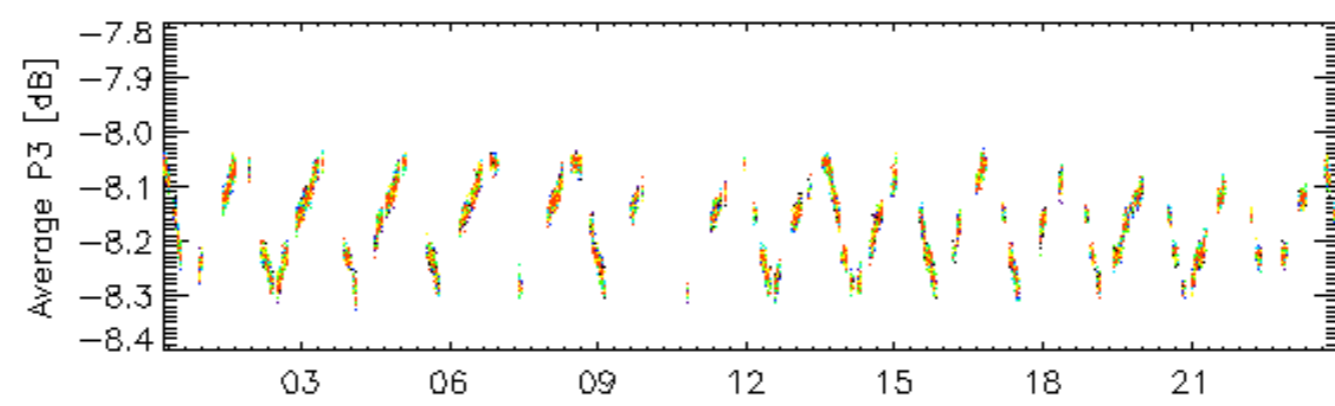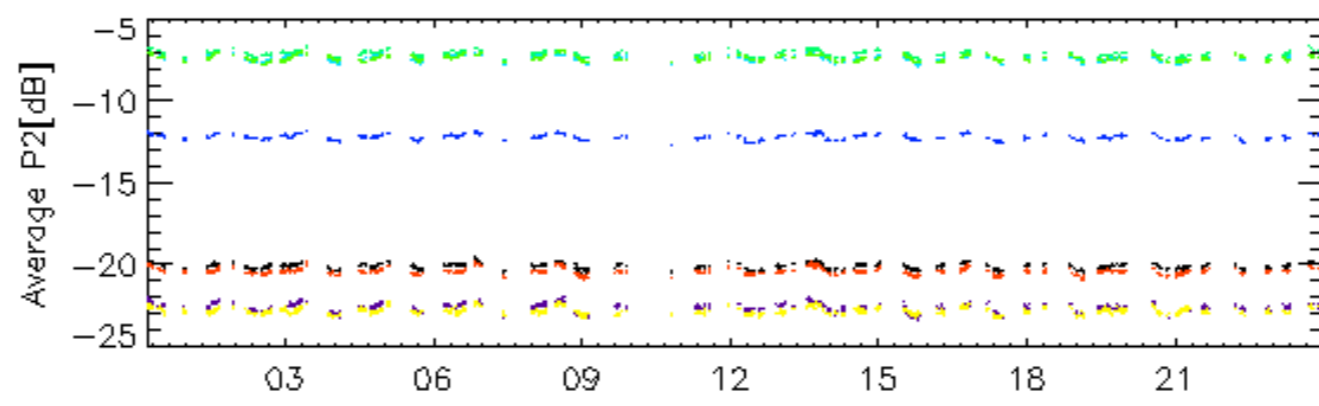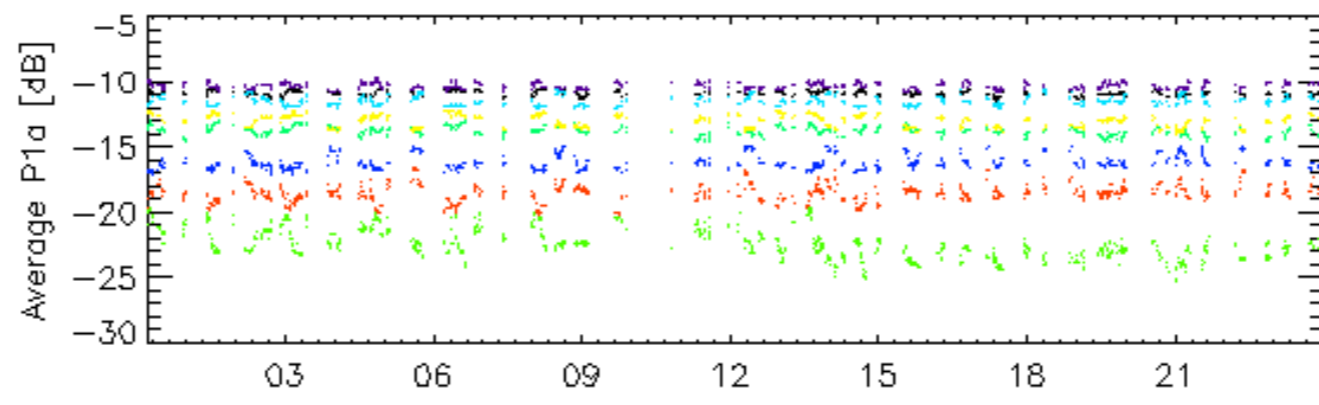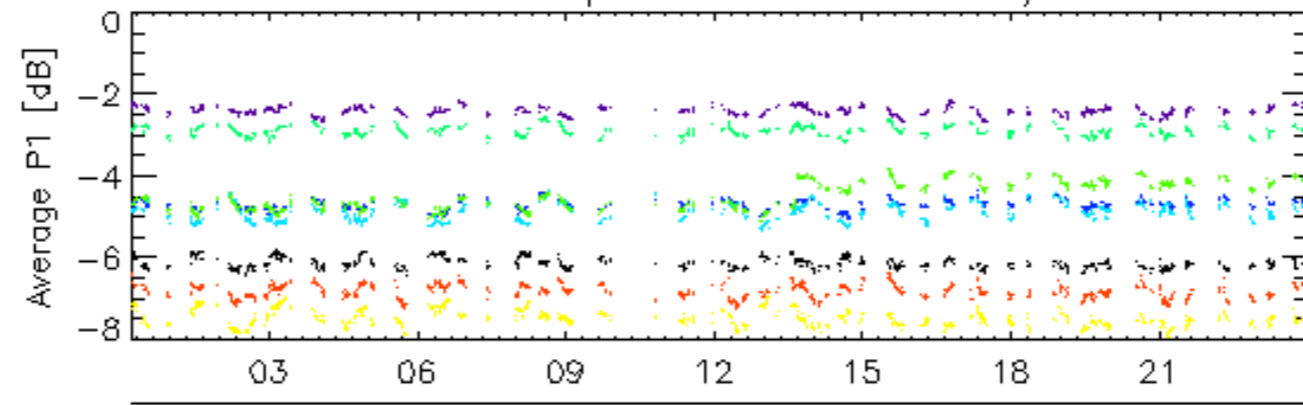





rows: 2 6 10 14 18 22 26 30

Calibration pulses for GM1 SS3 H/H

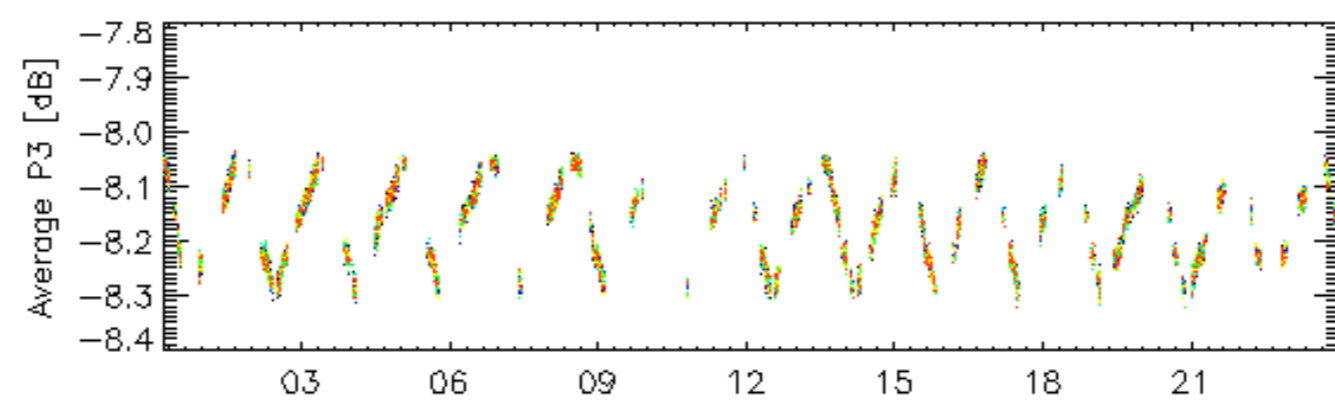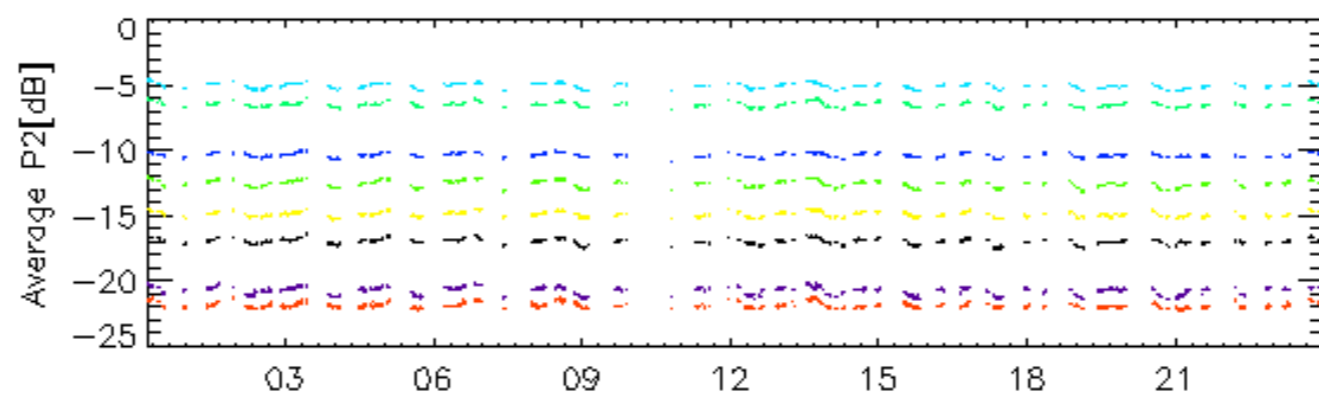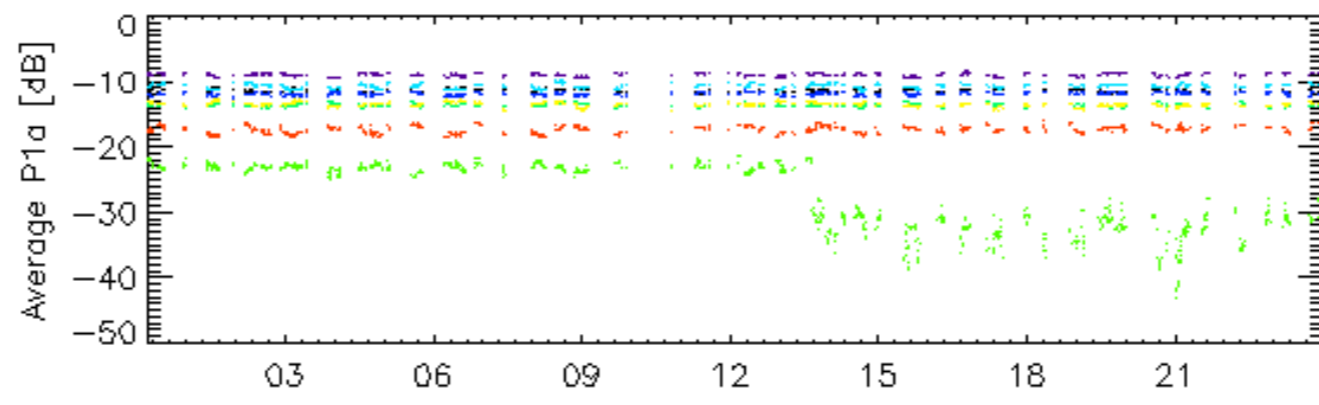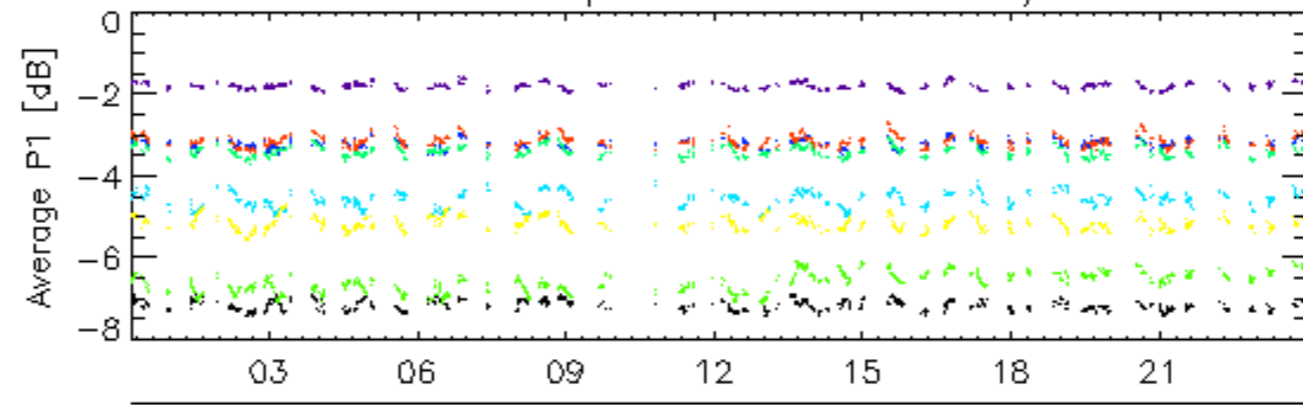


rows: 3 7 11 15 19 23 27 31


Calibration pulses for GM1 SS3 H/H

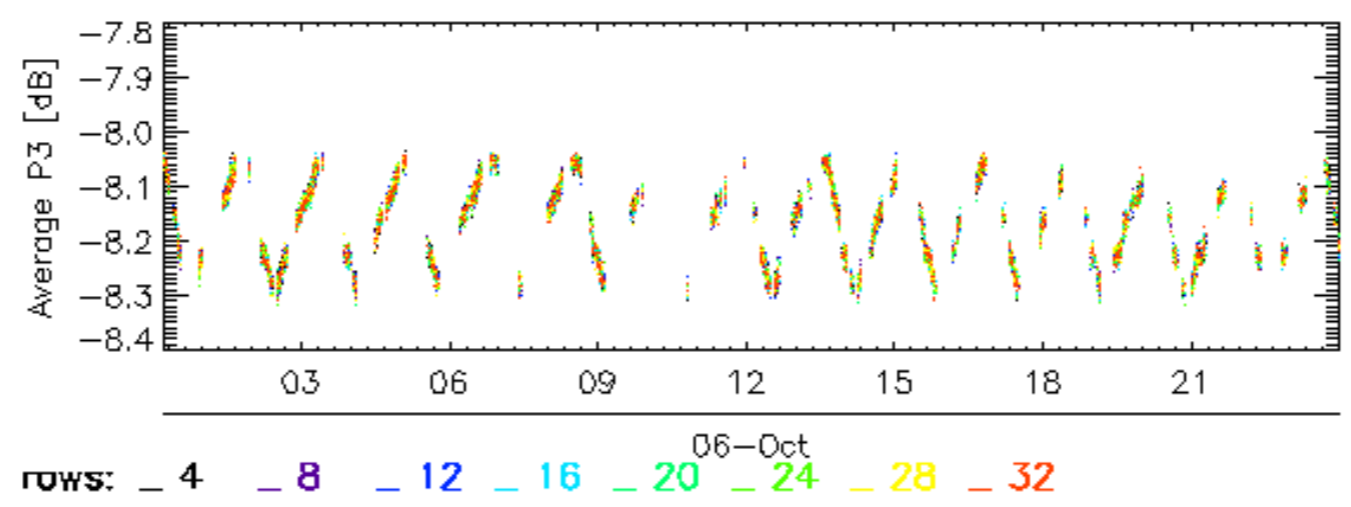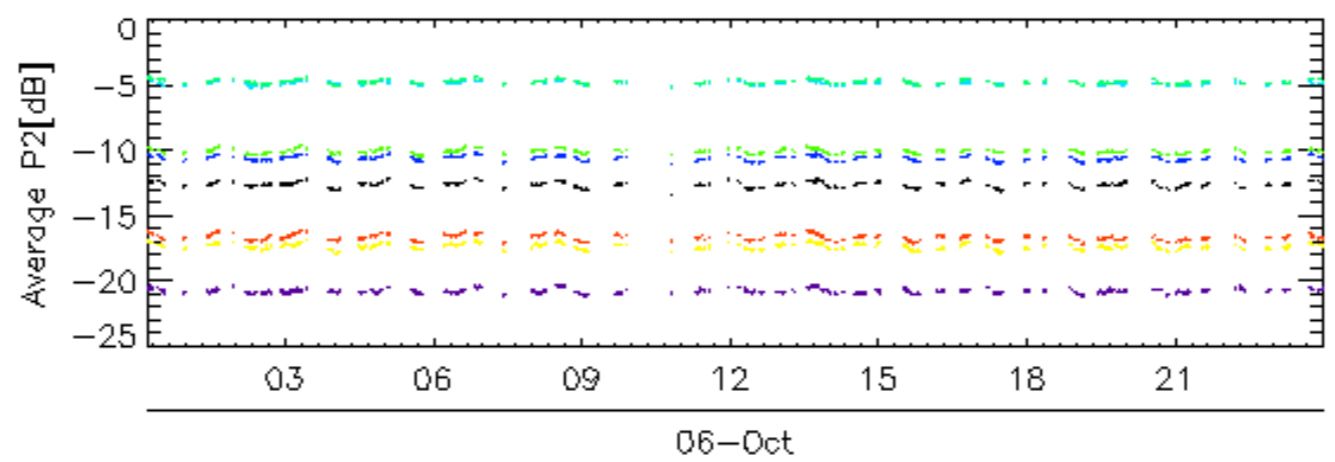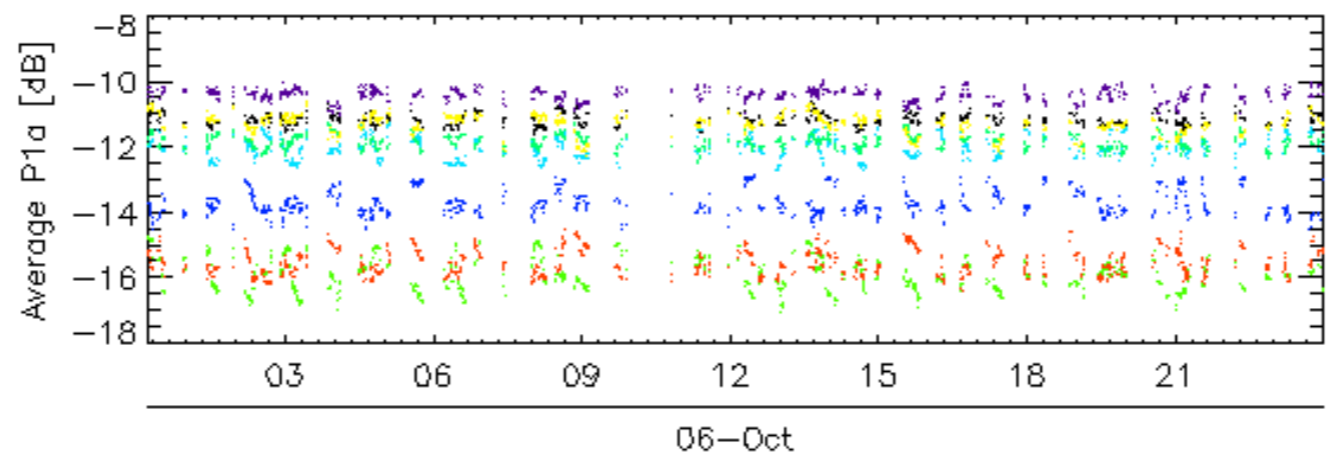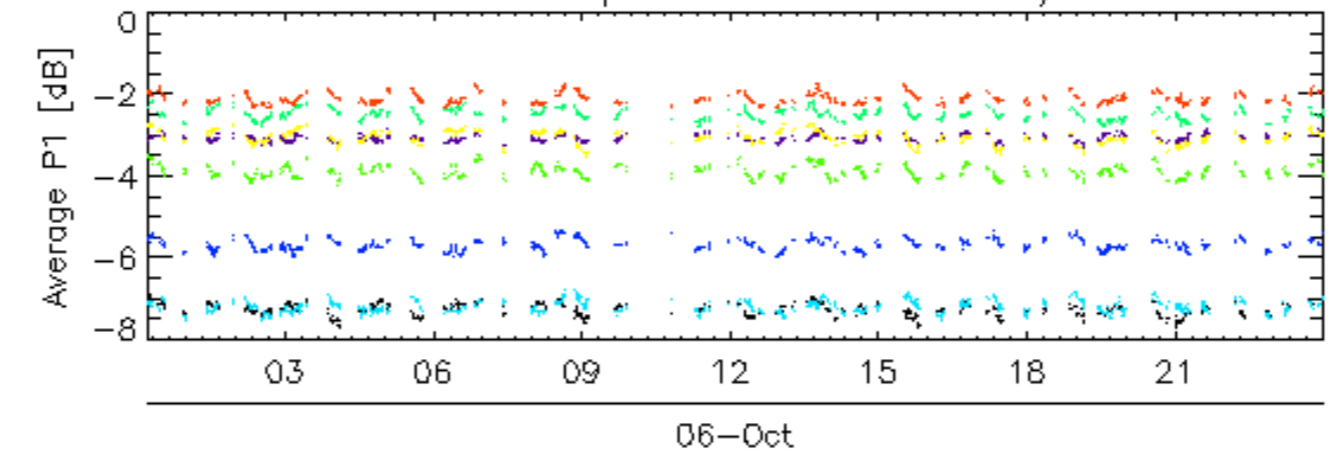


Calibration pulses for WVS IS2 V/V

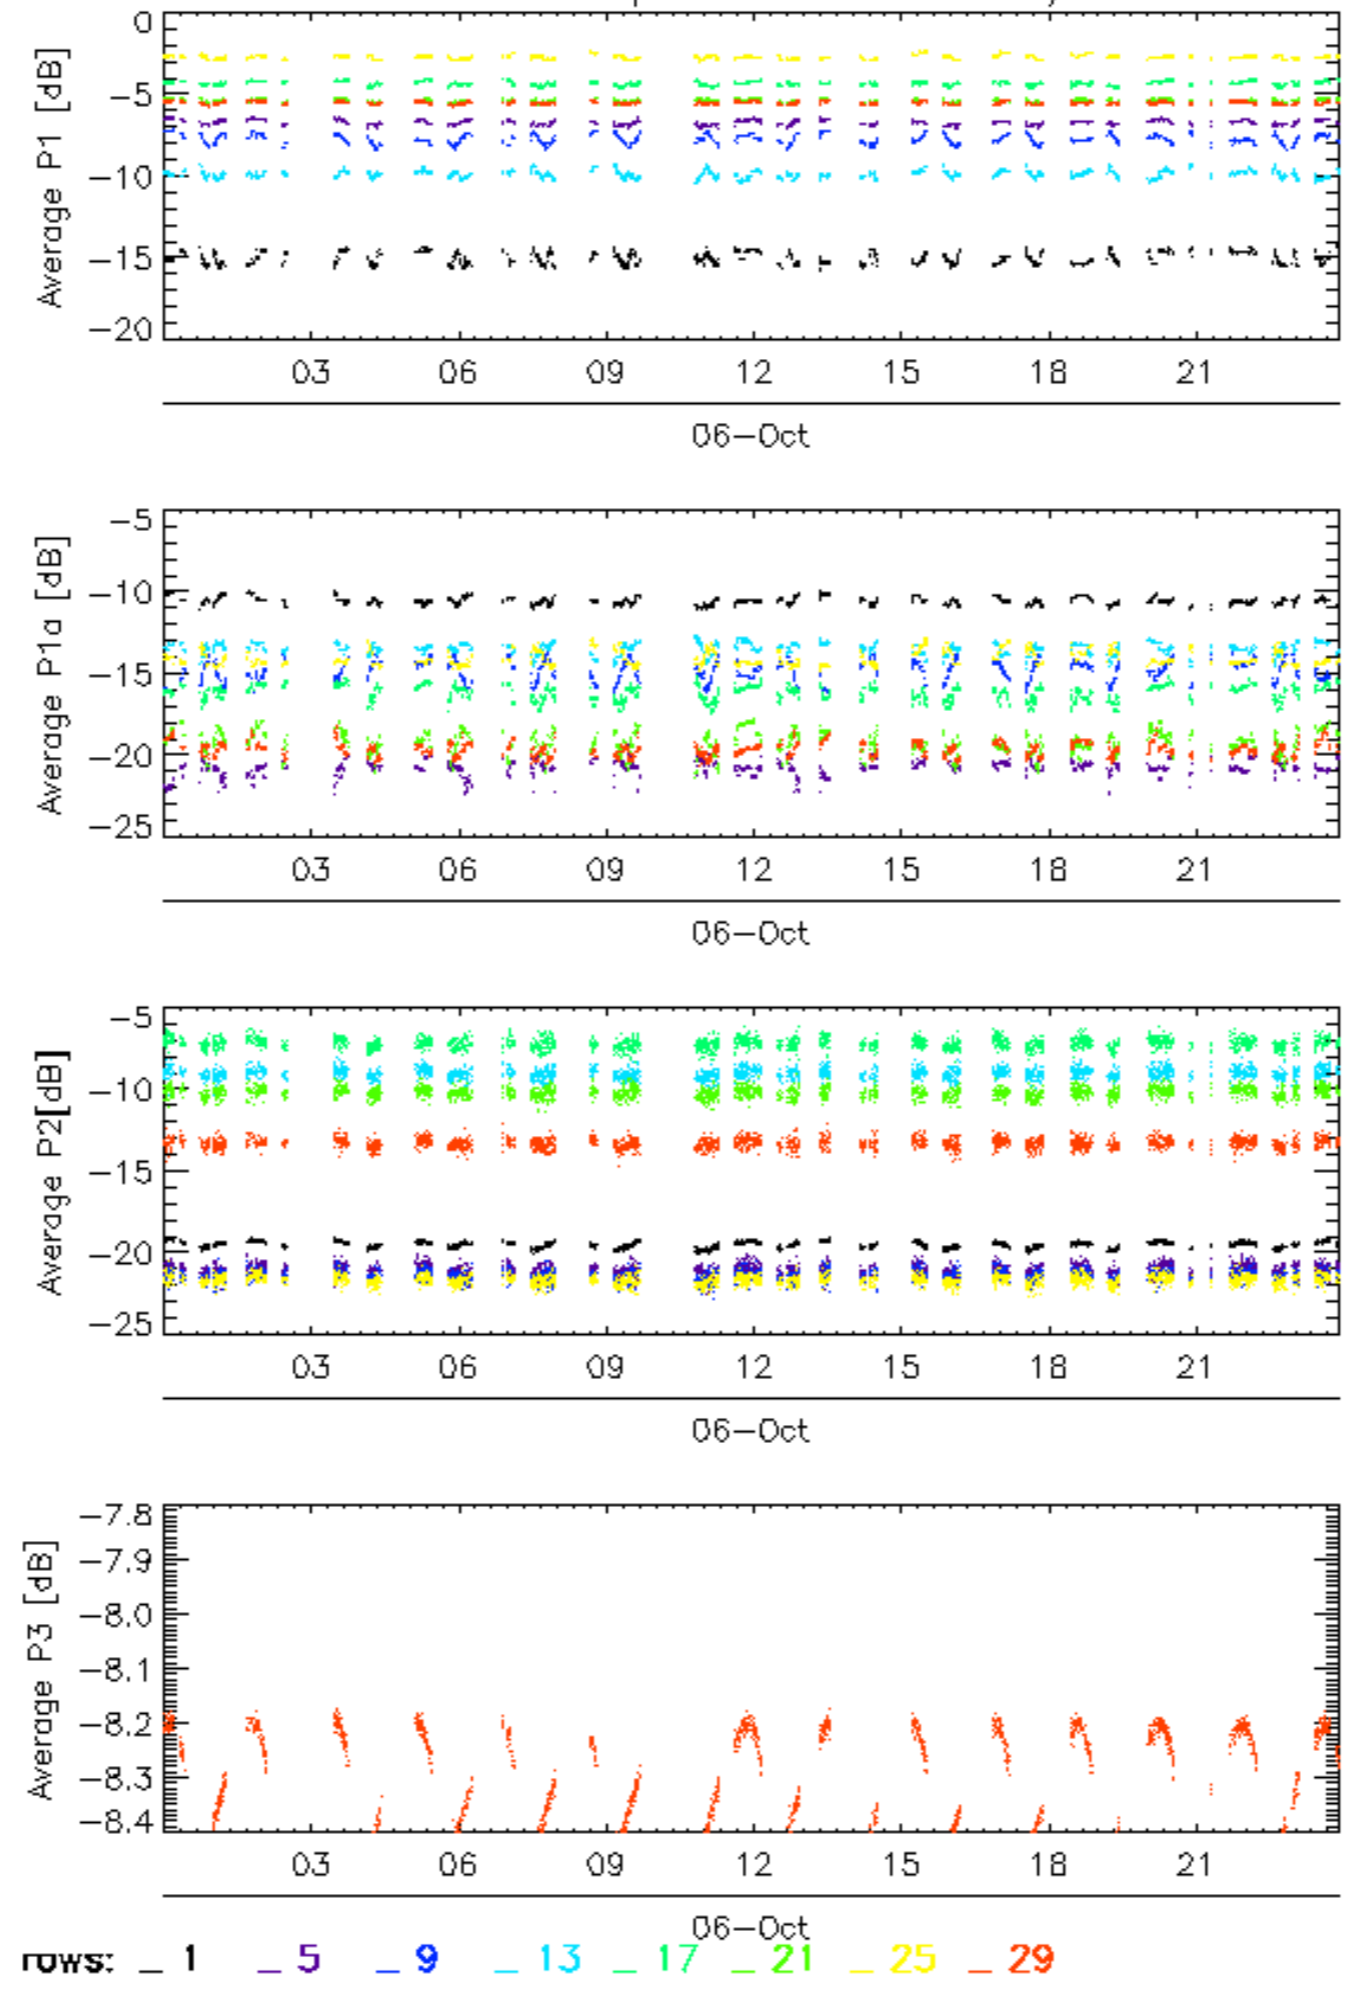


Calibration pulses for WVS IS2 V/V

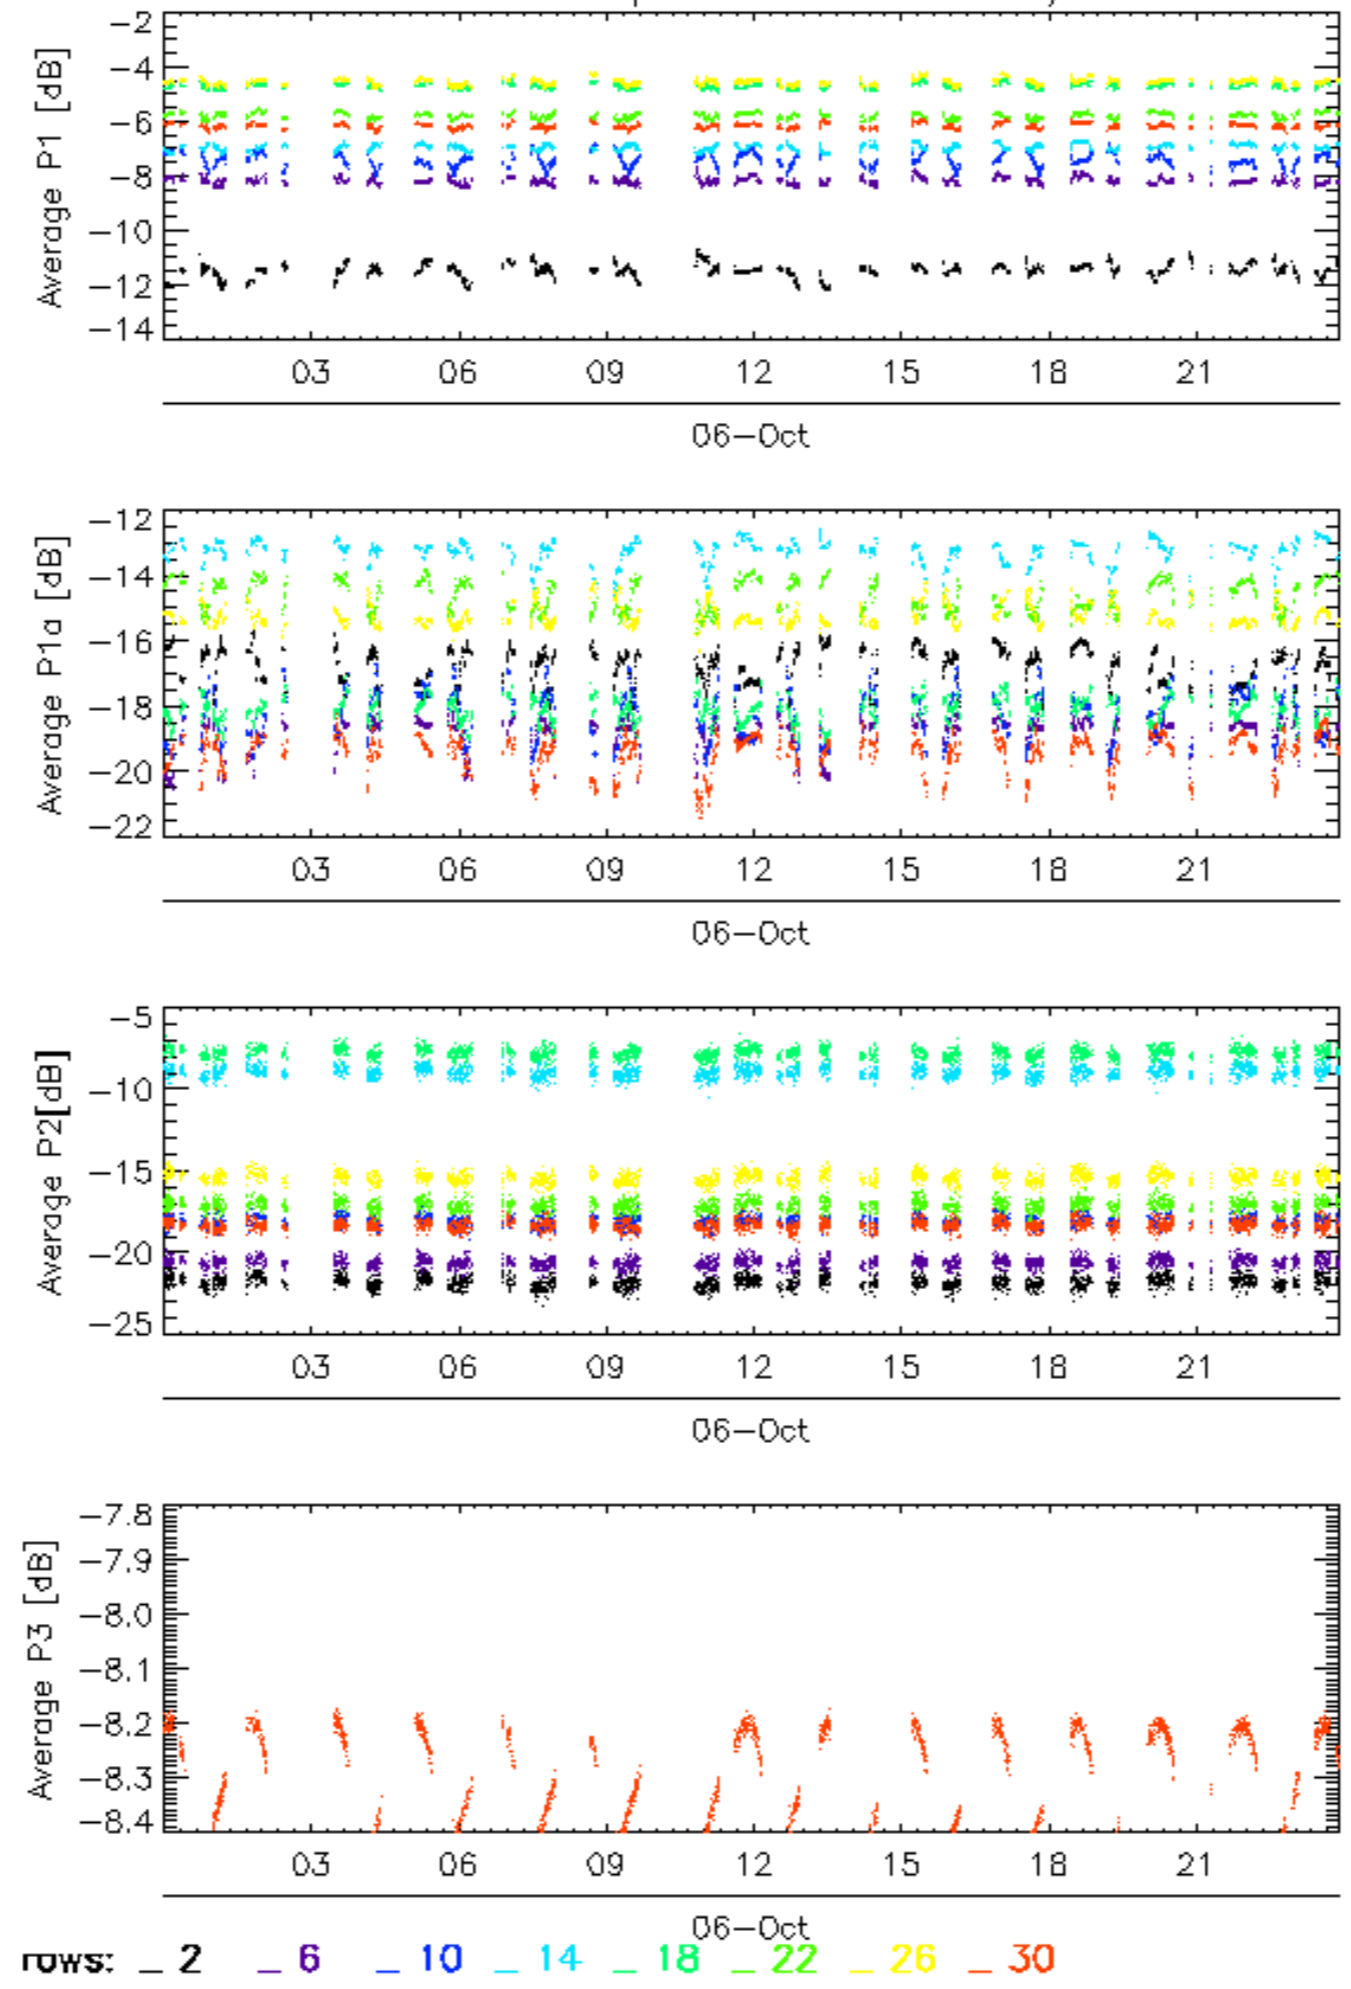



Calibration pulses for WVS IS2 V/V


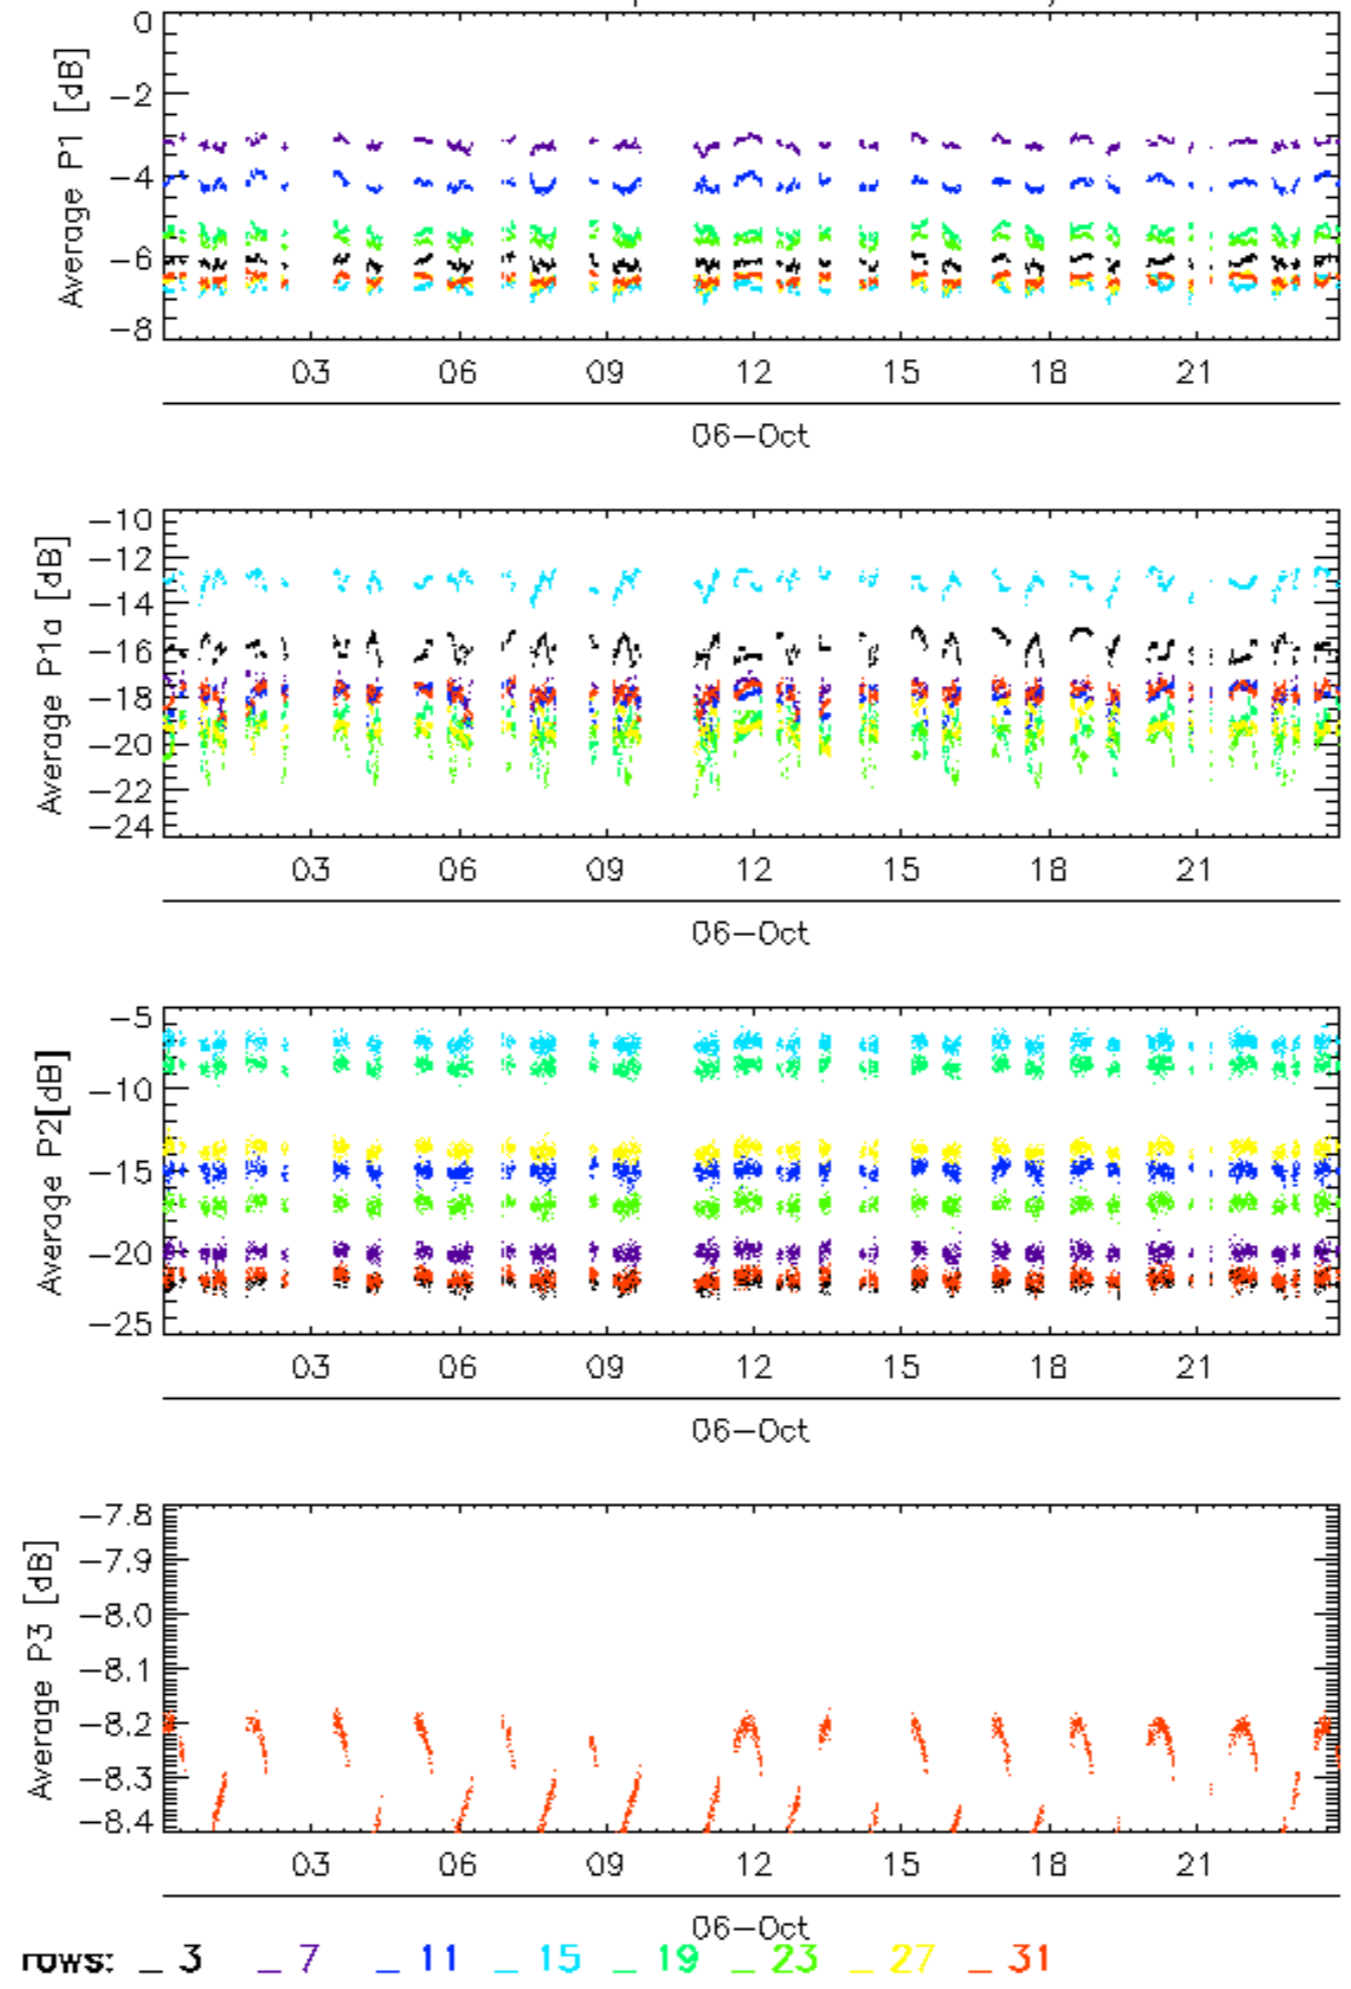




Calibration pulses for WVS IS2 V/V


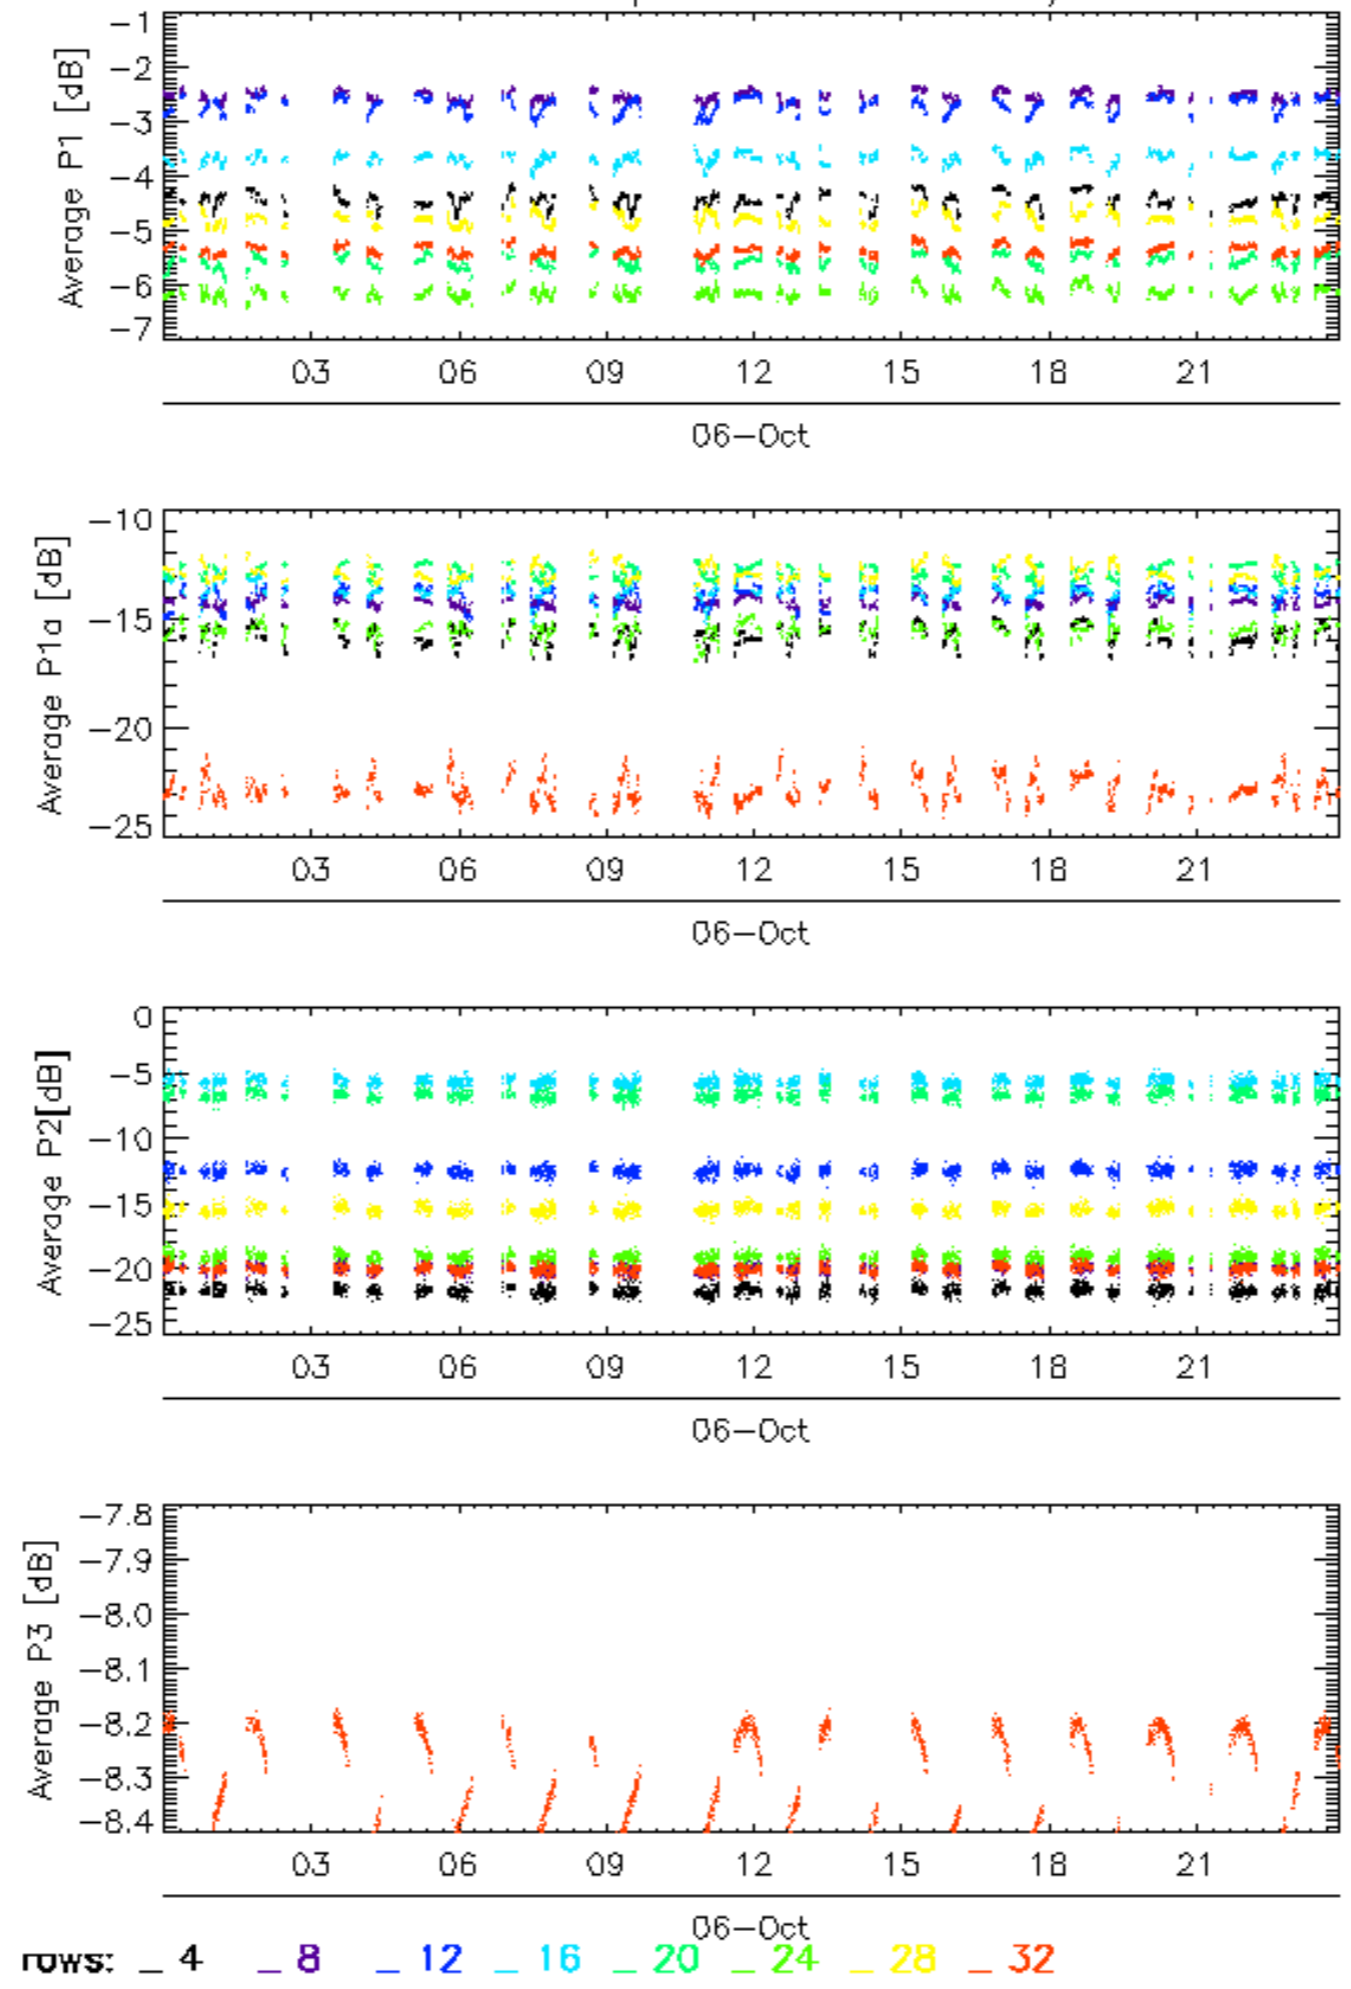



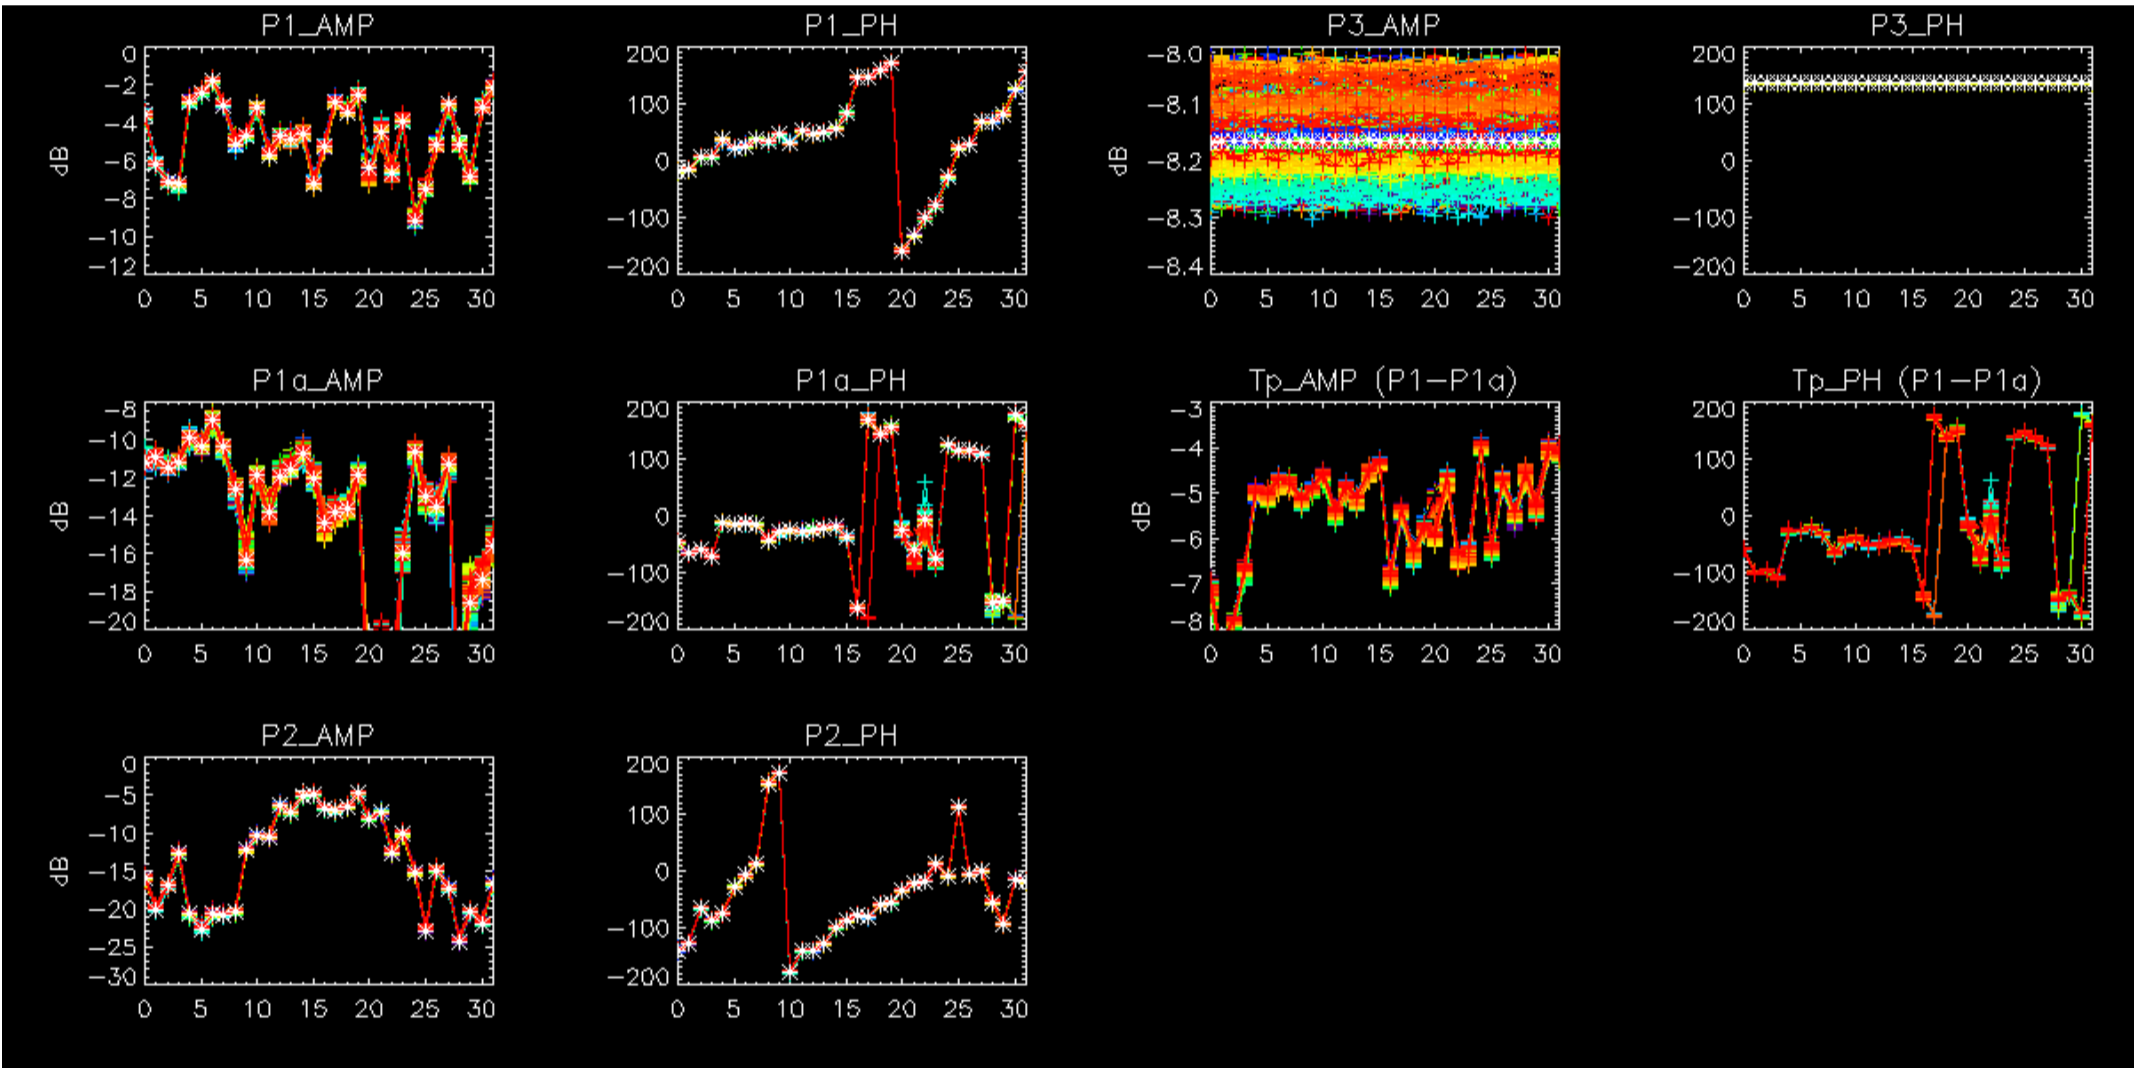



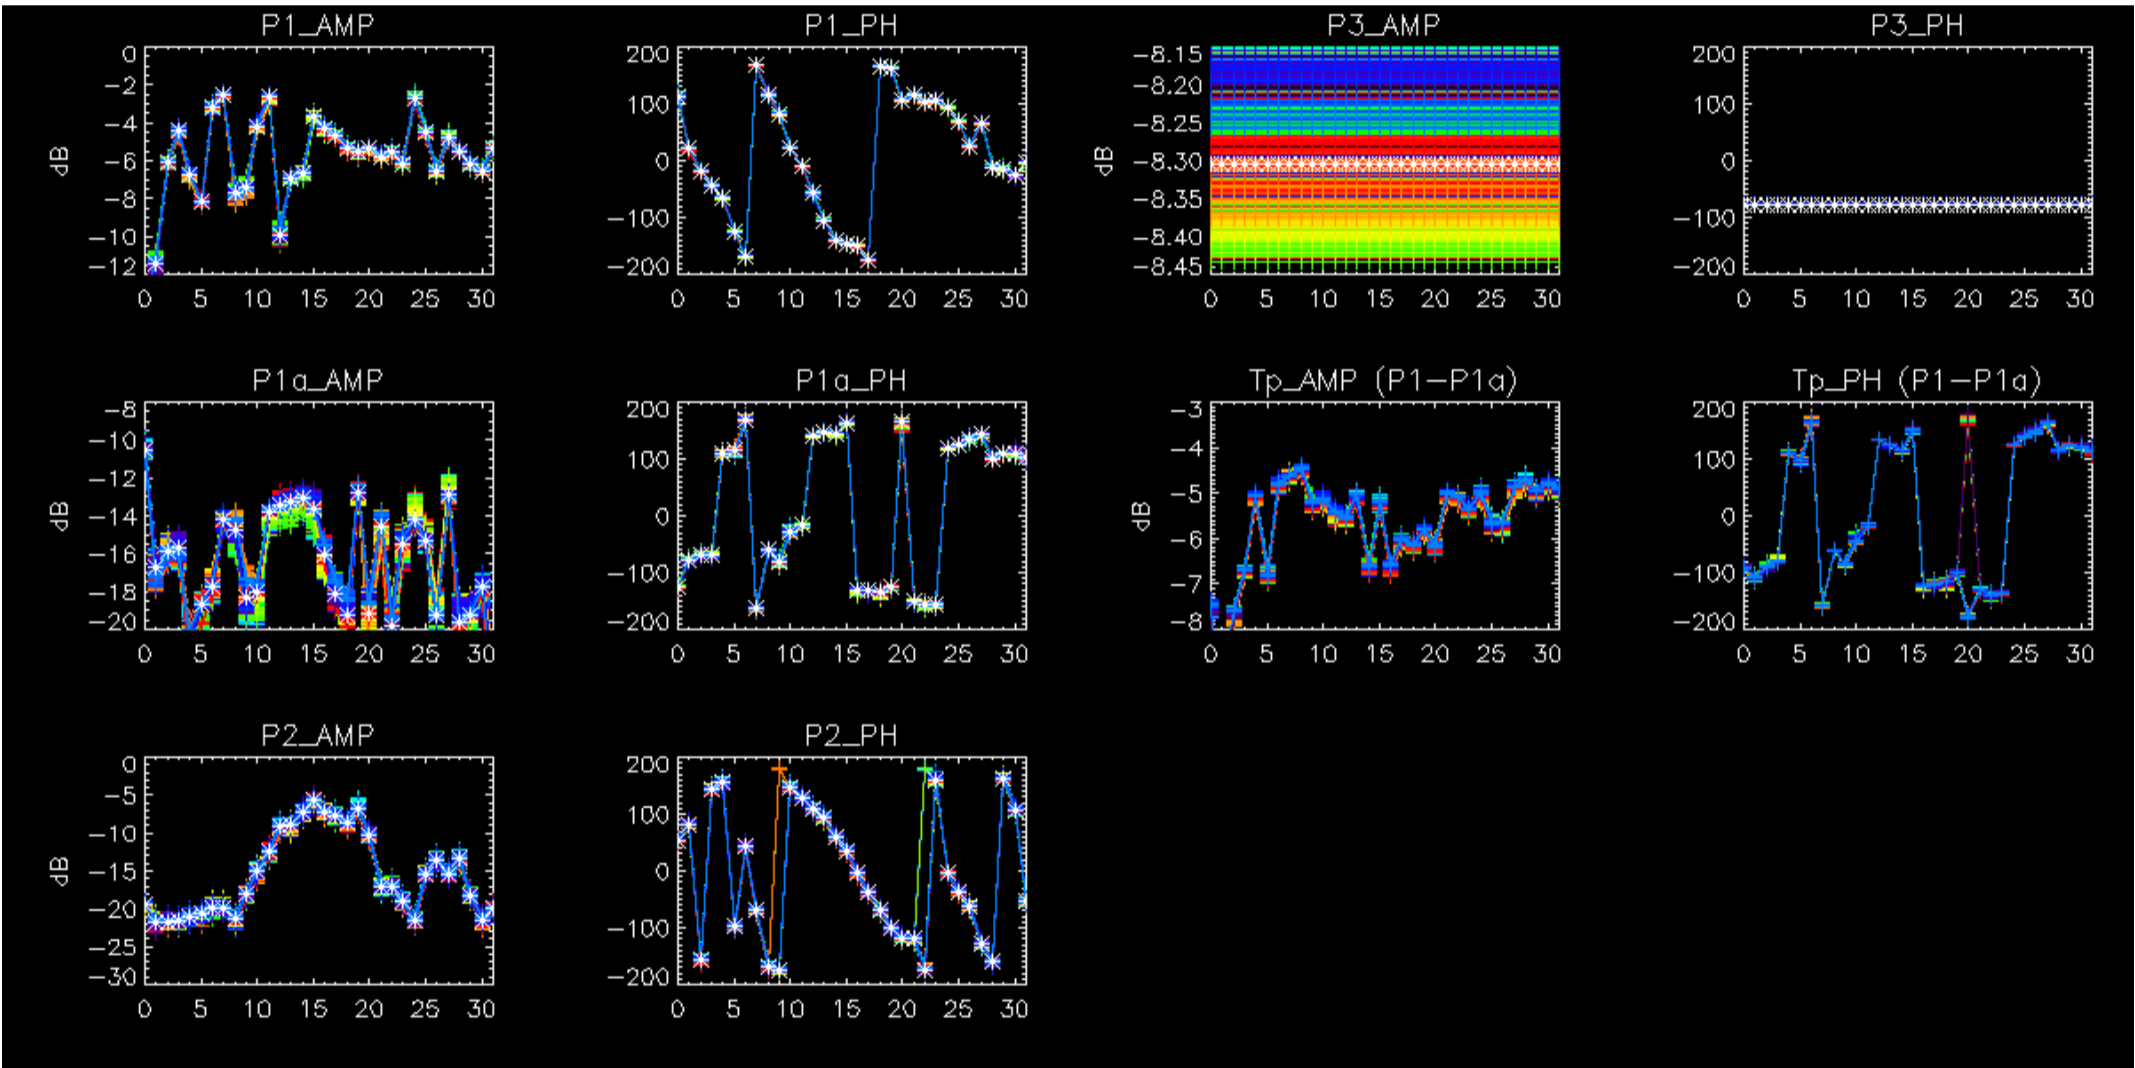


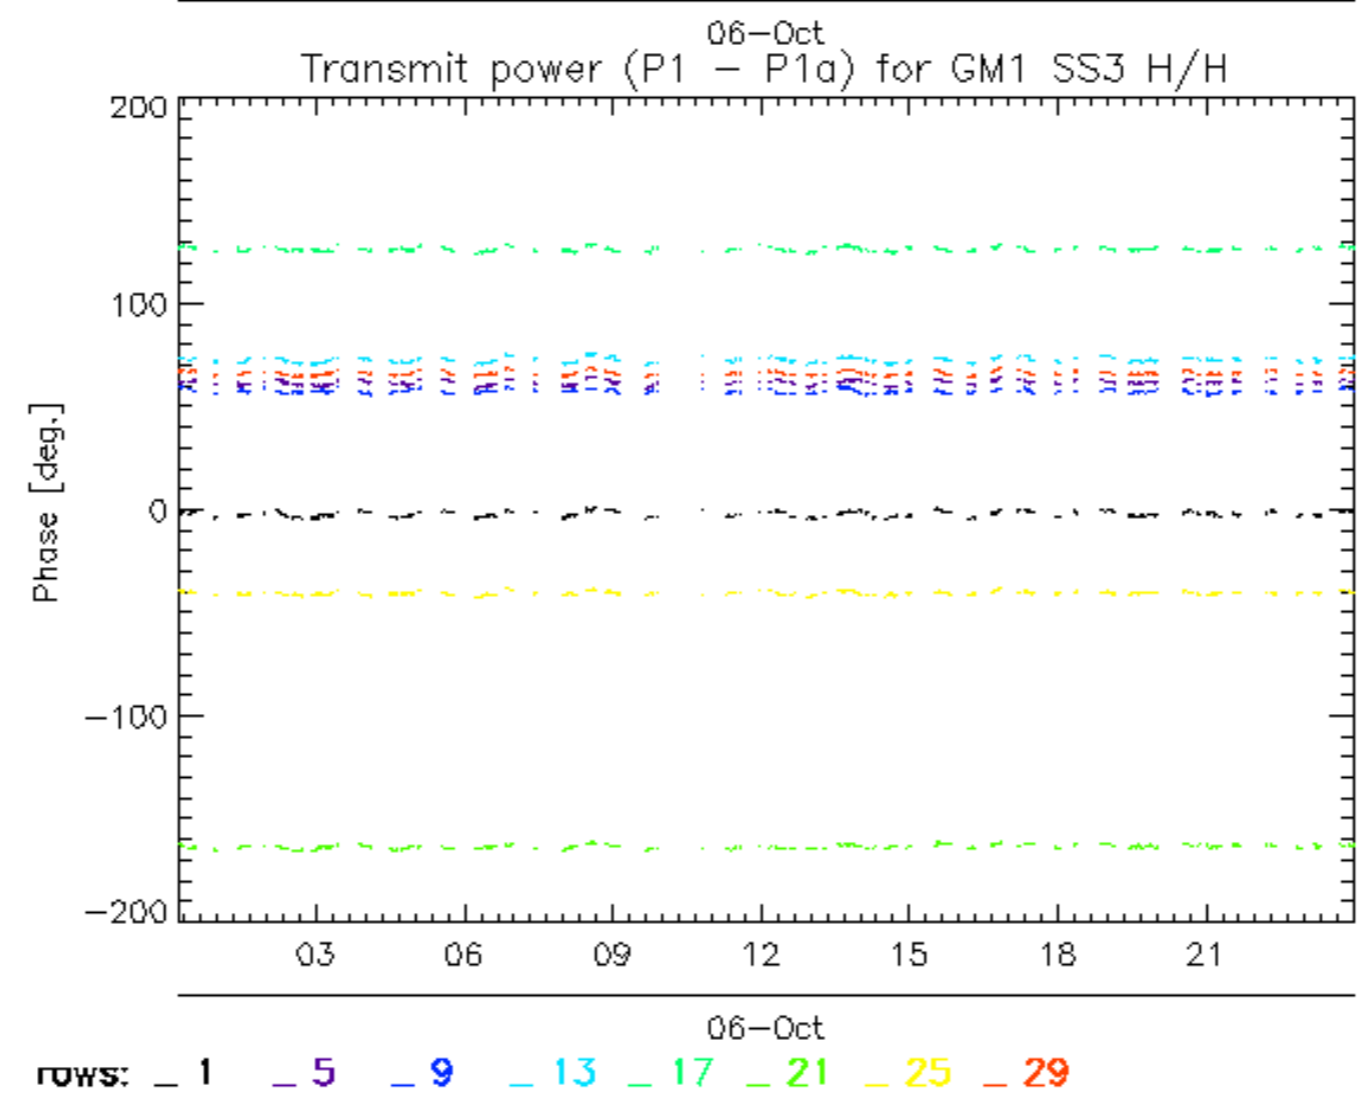
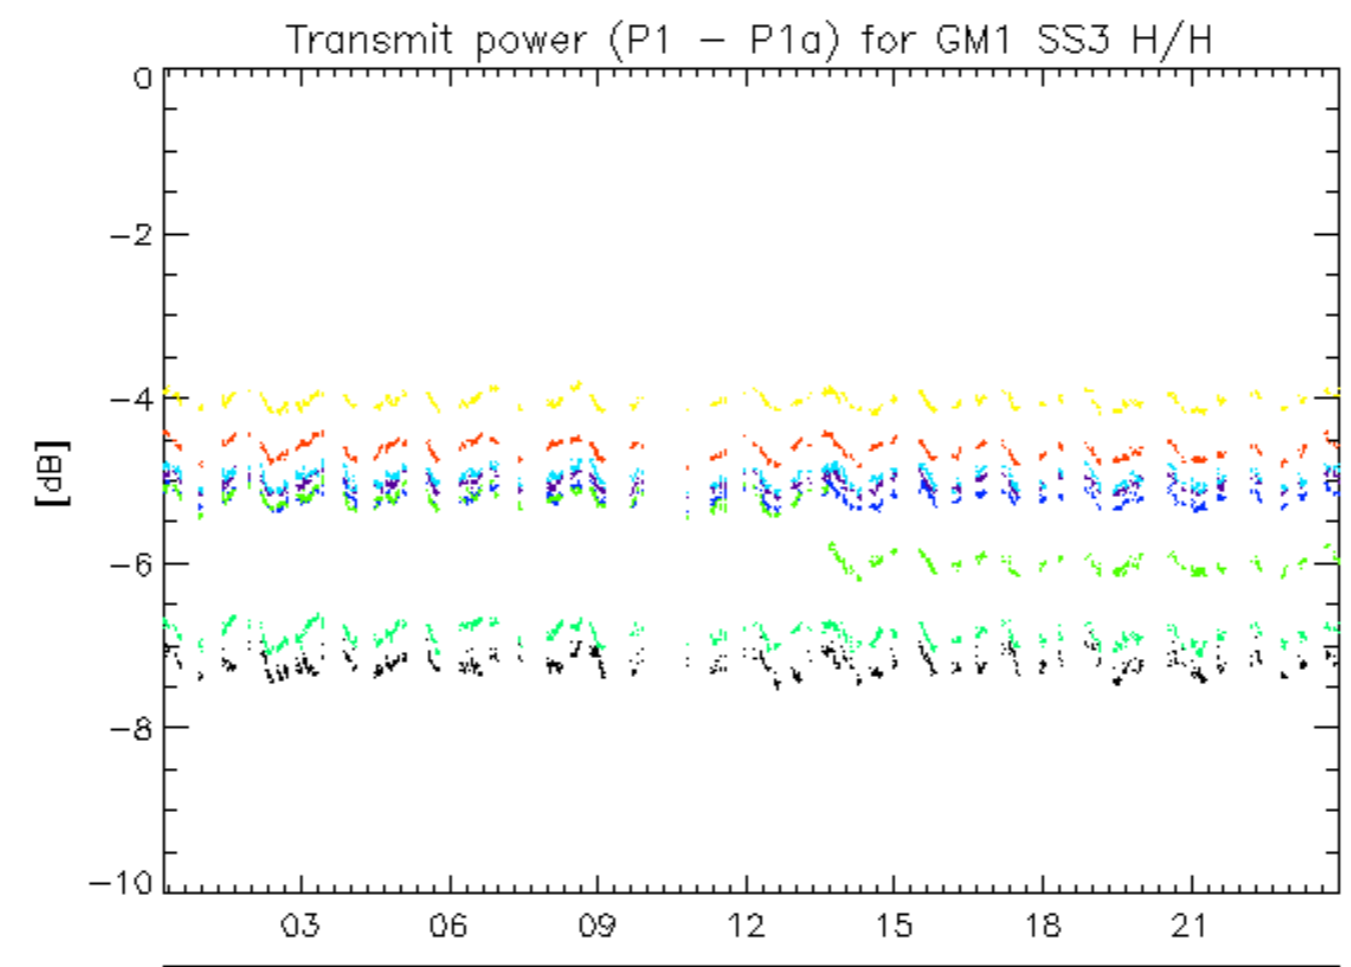


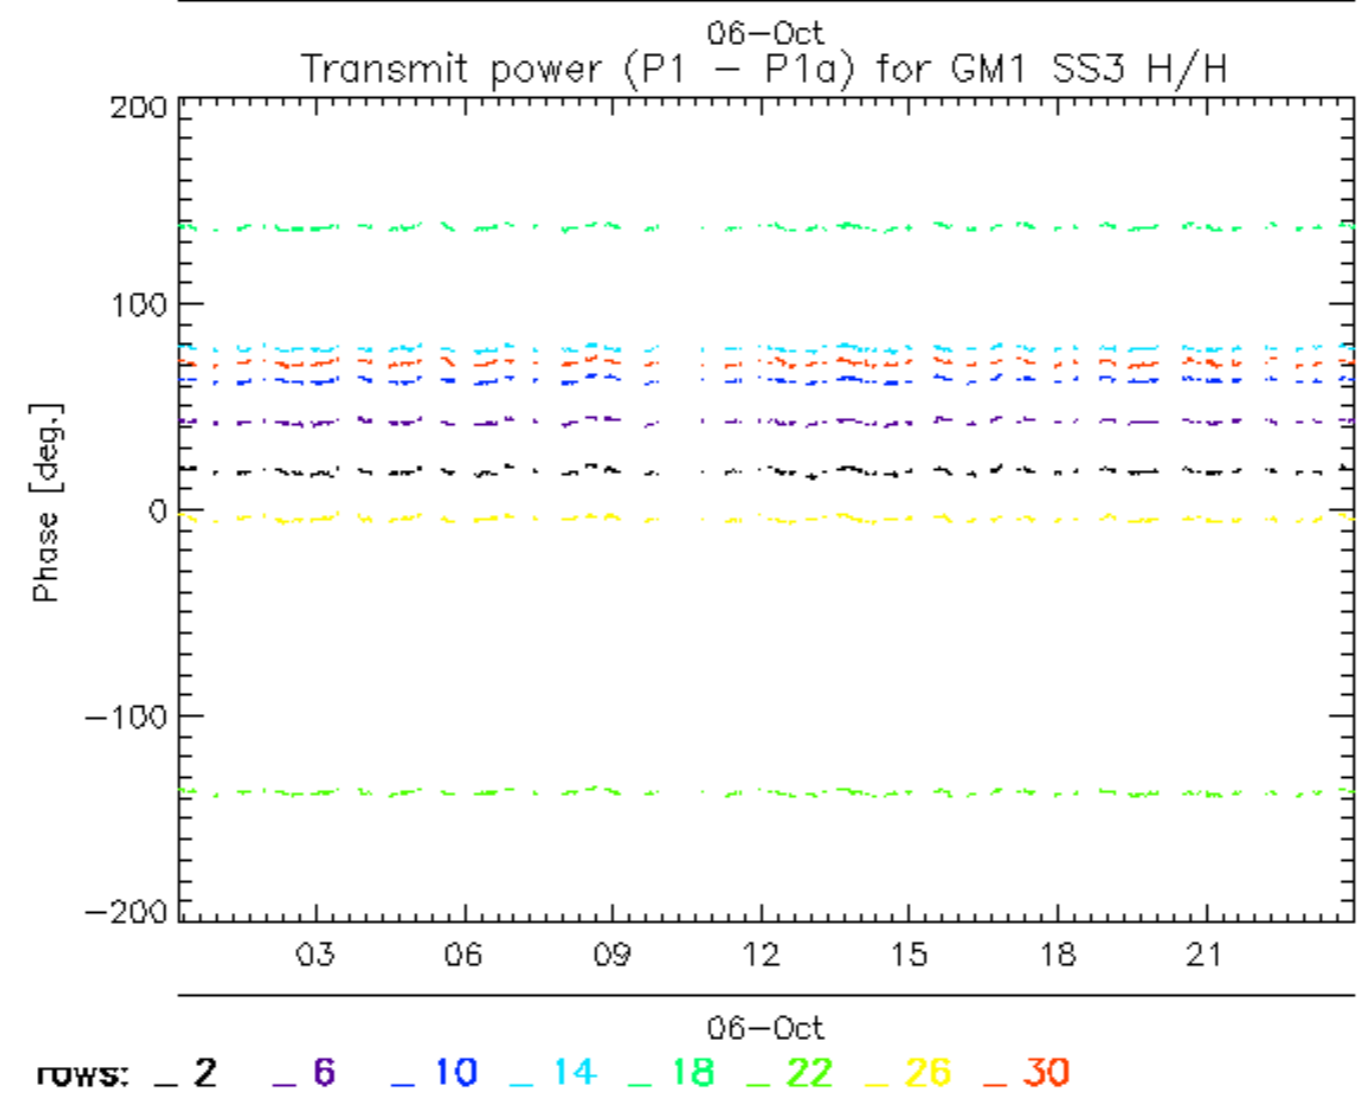
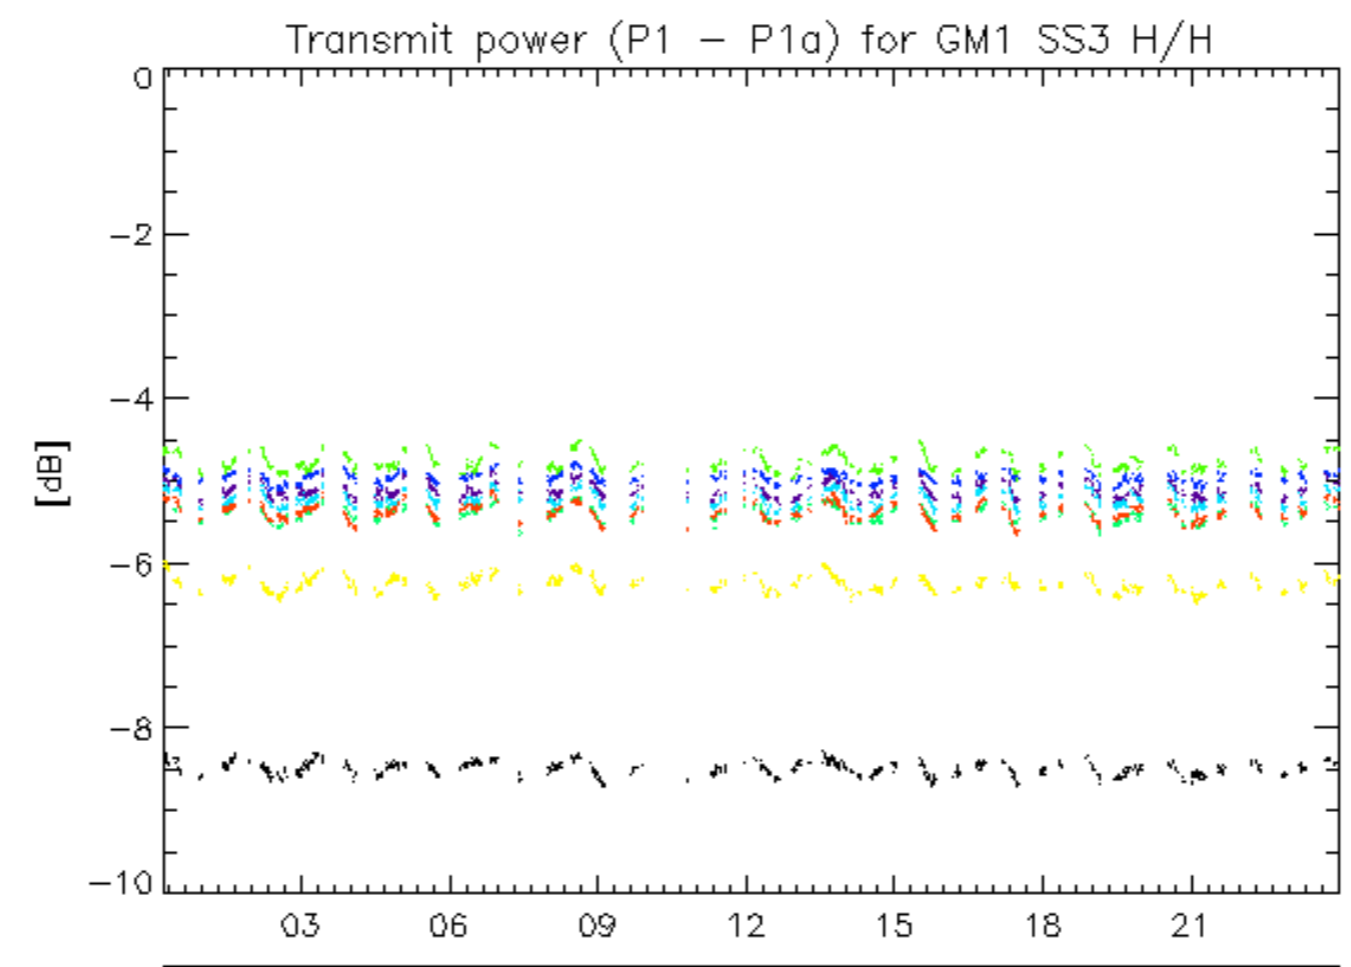


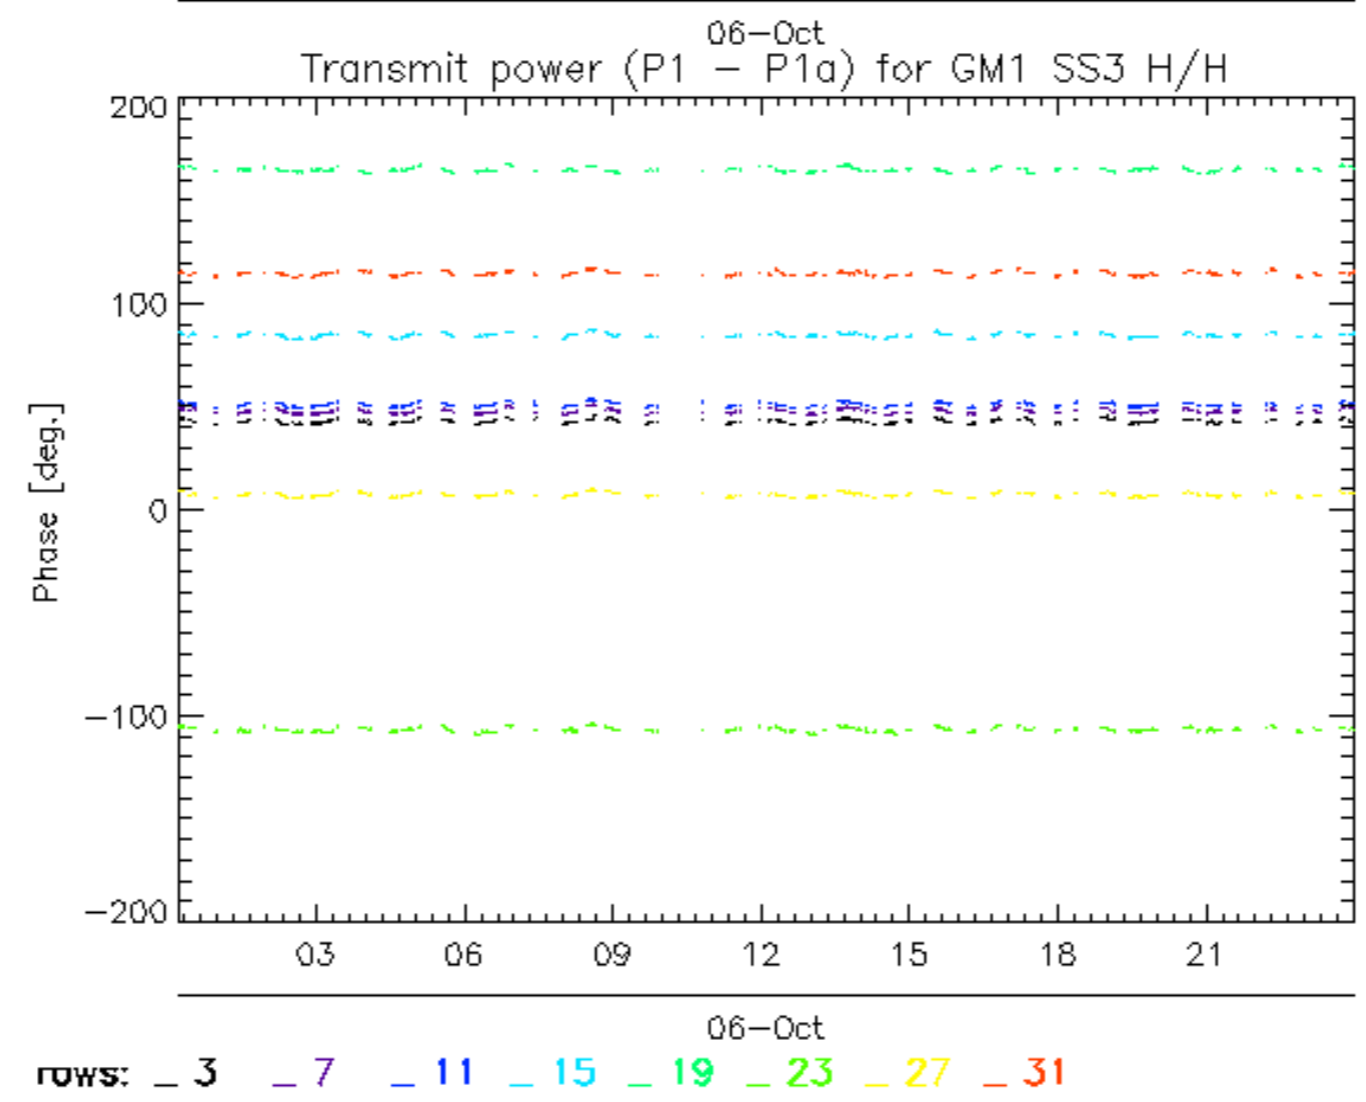
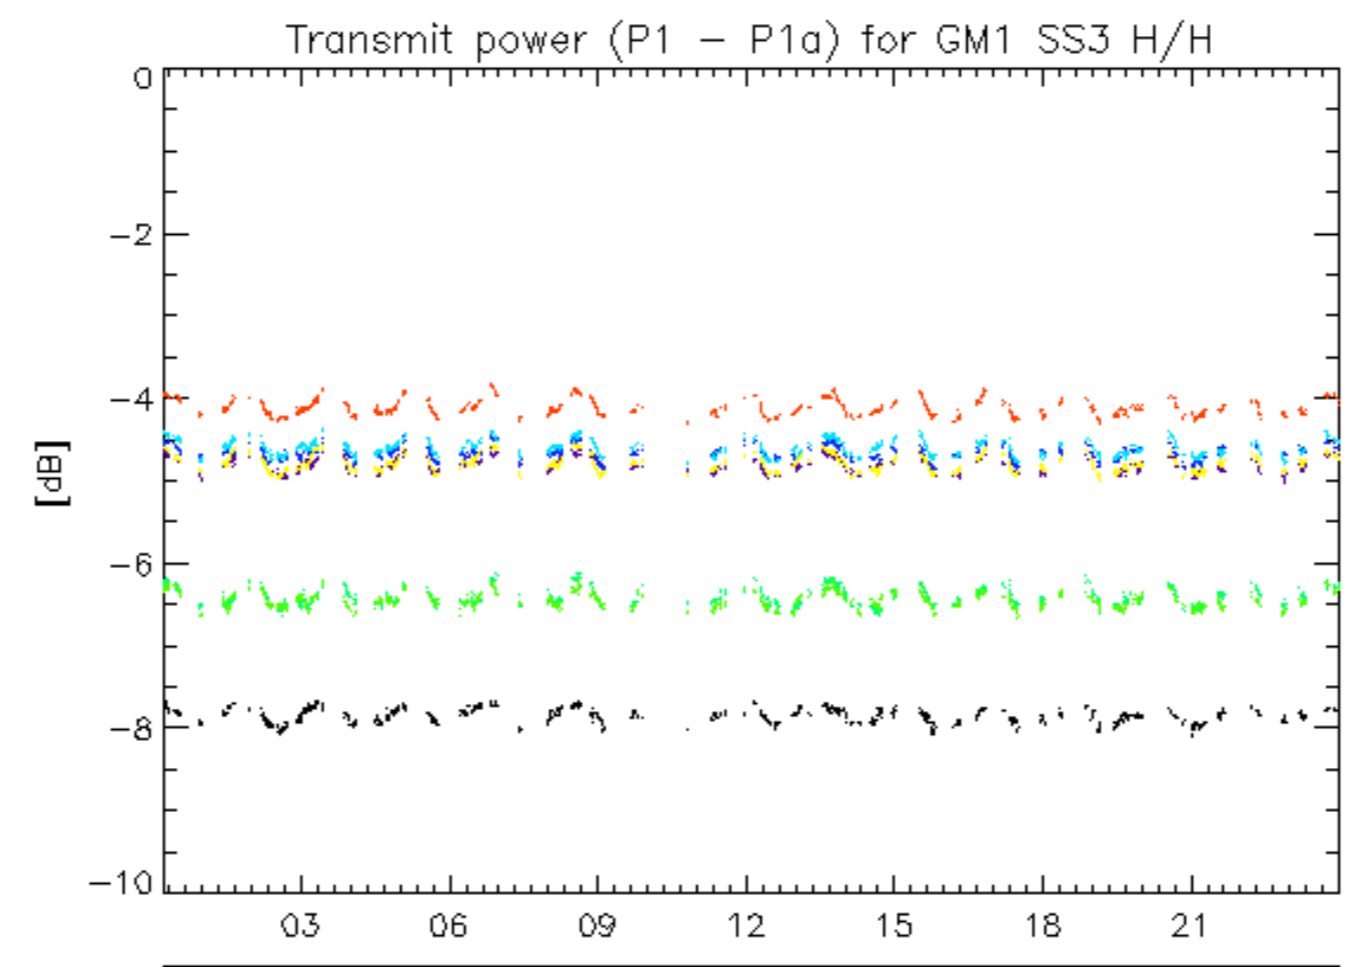


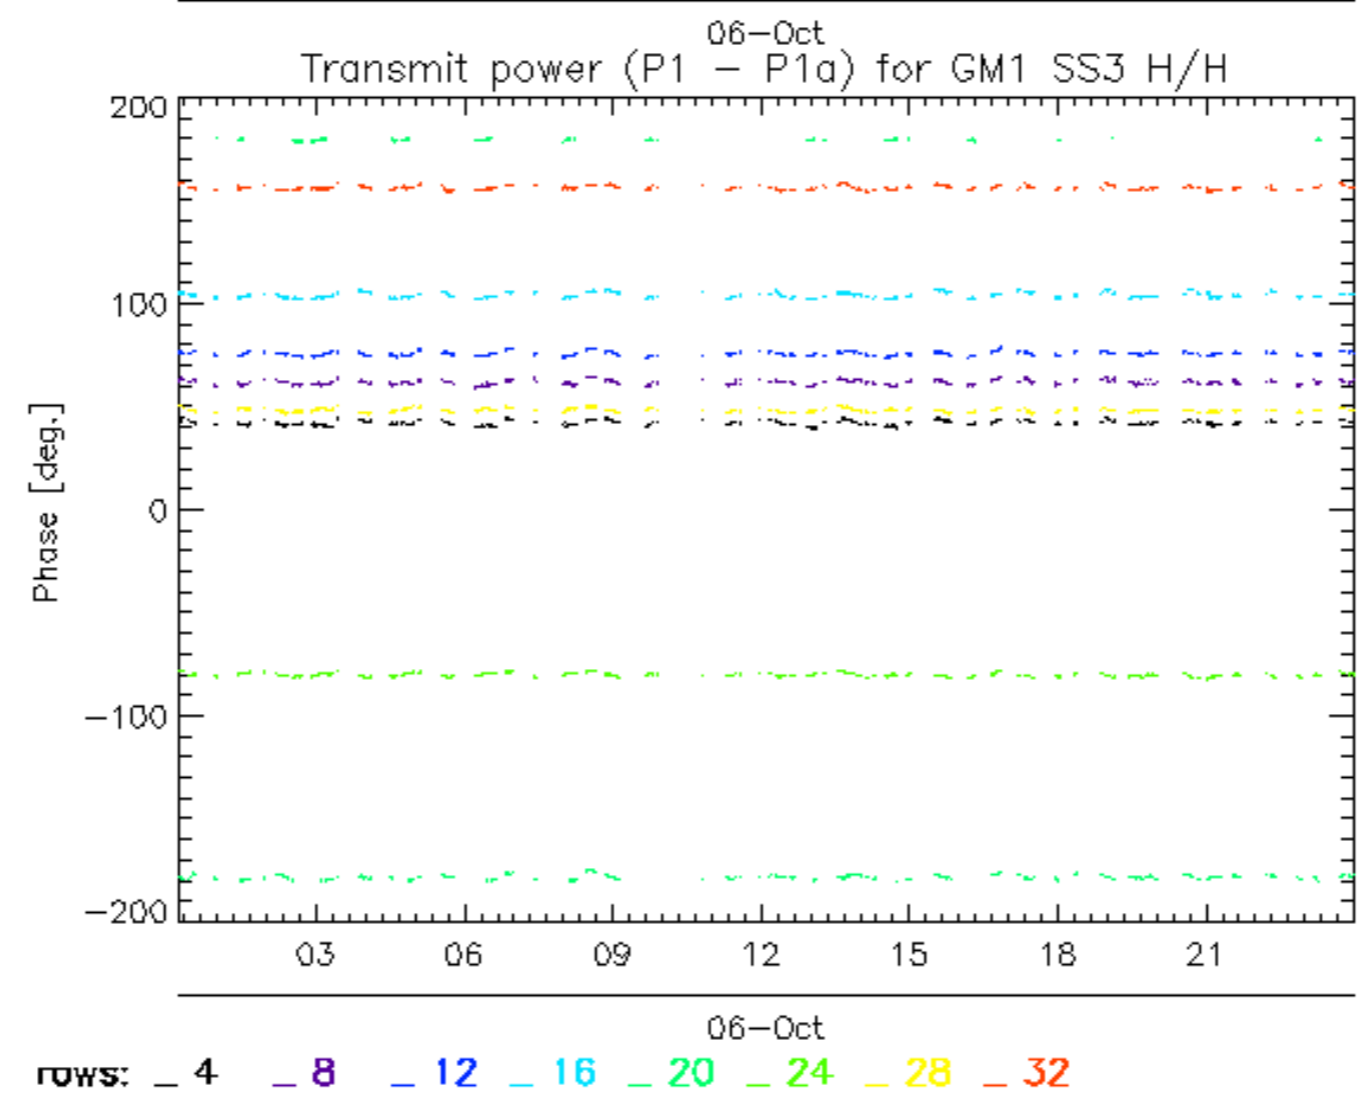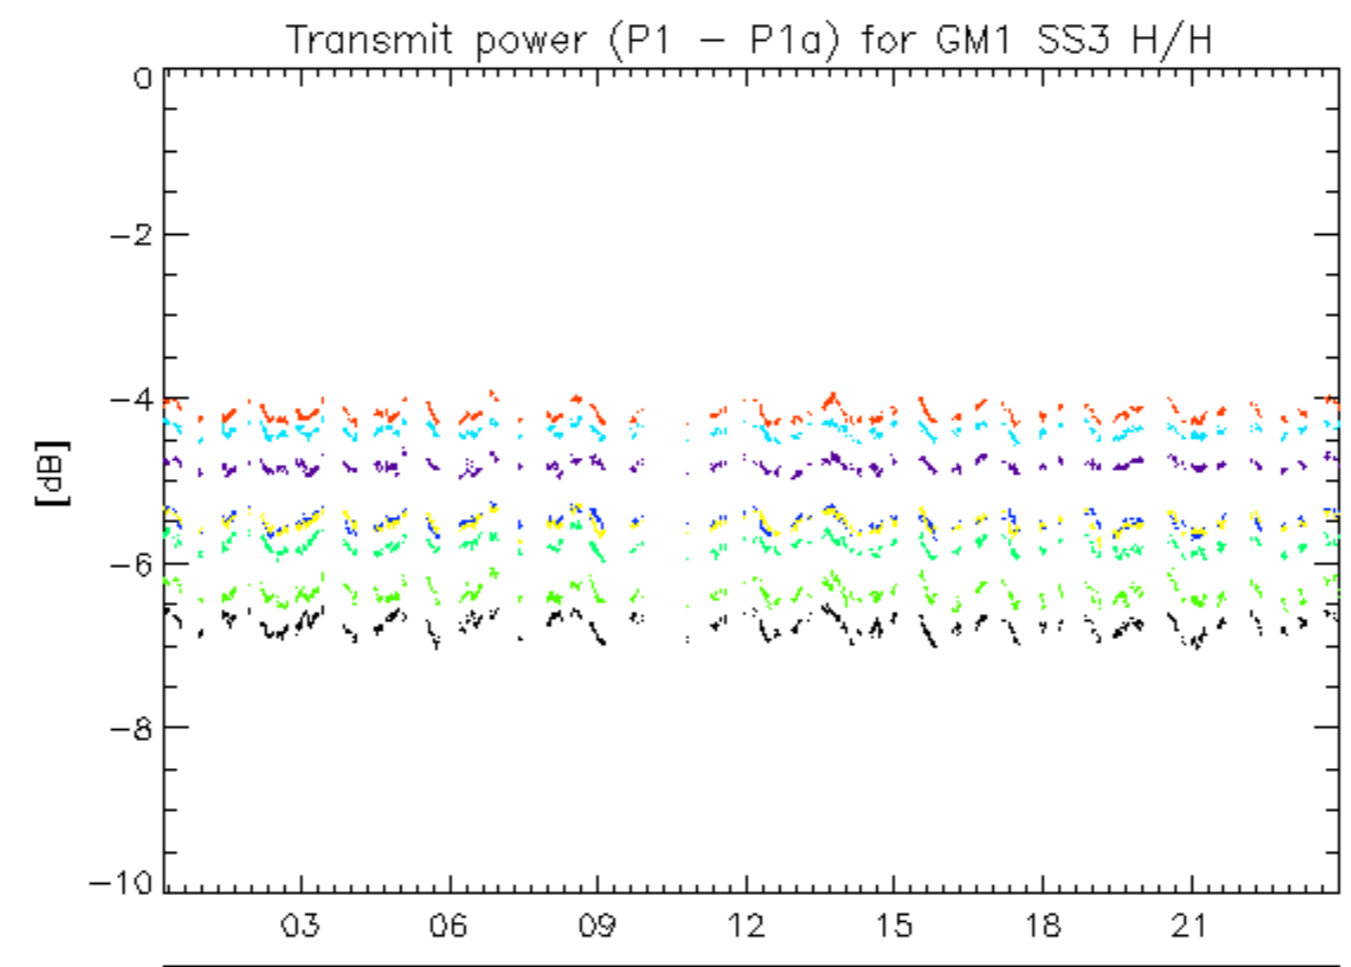


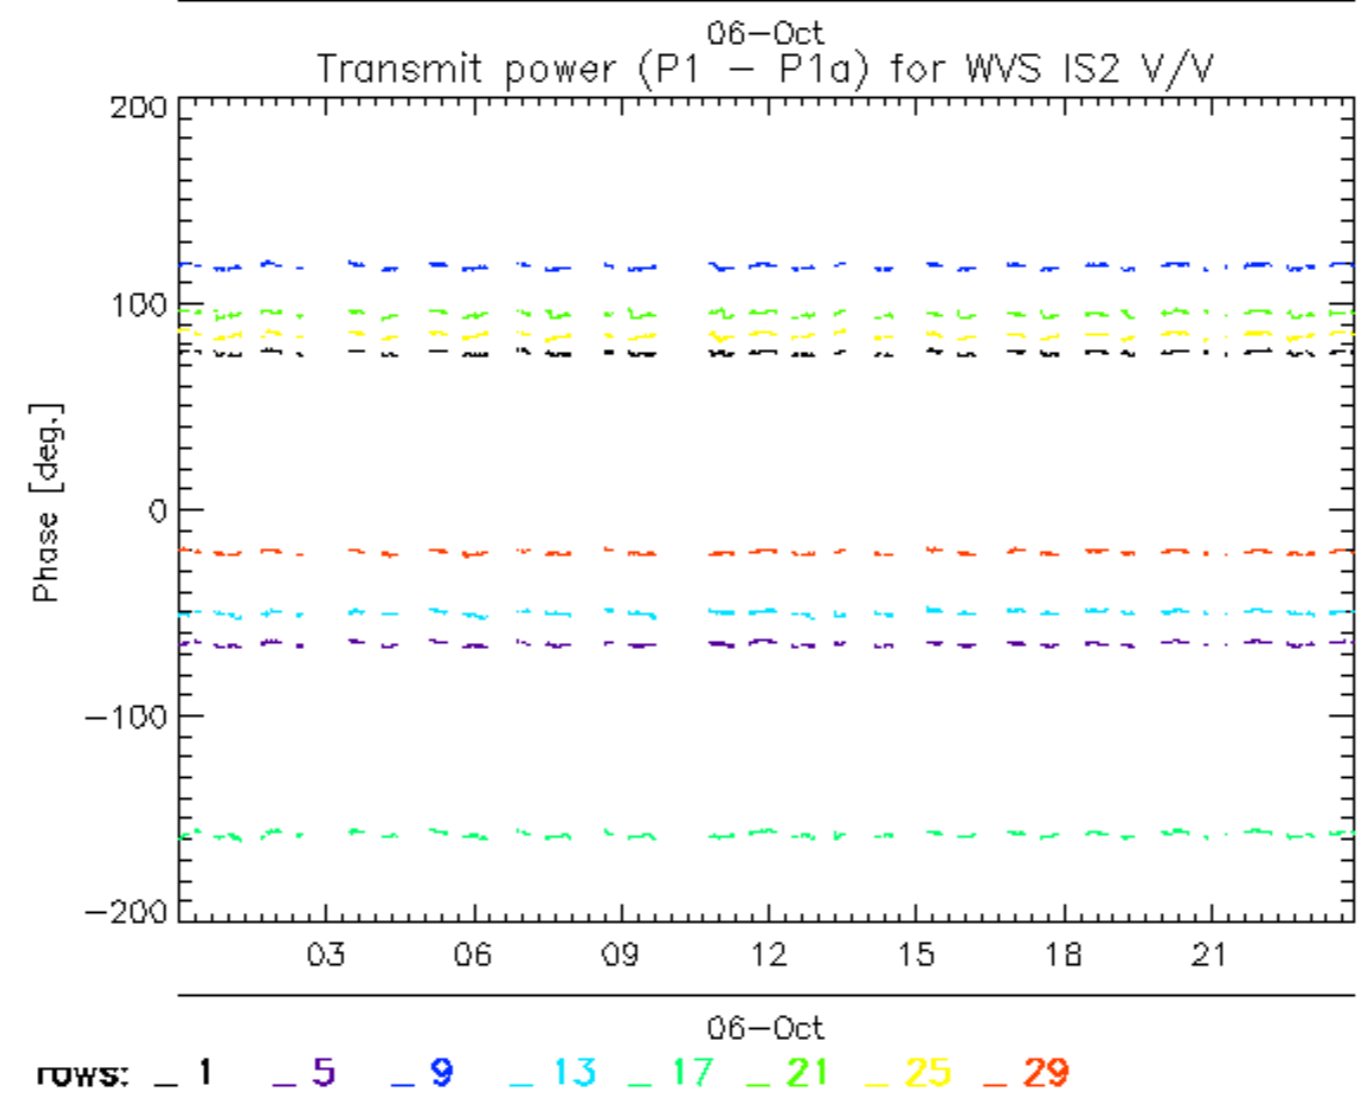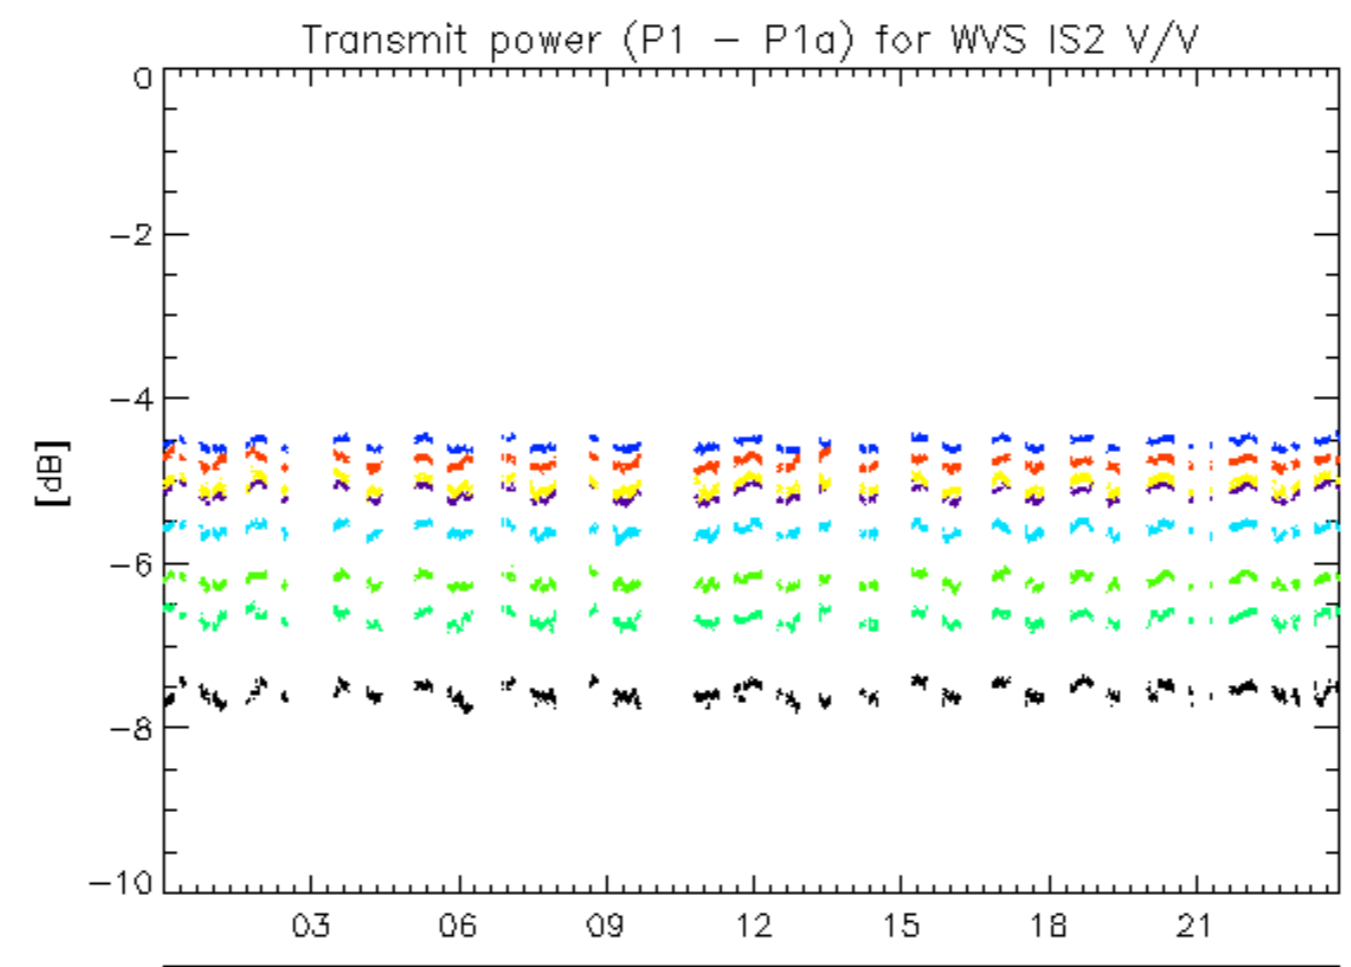


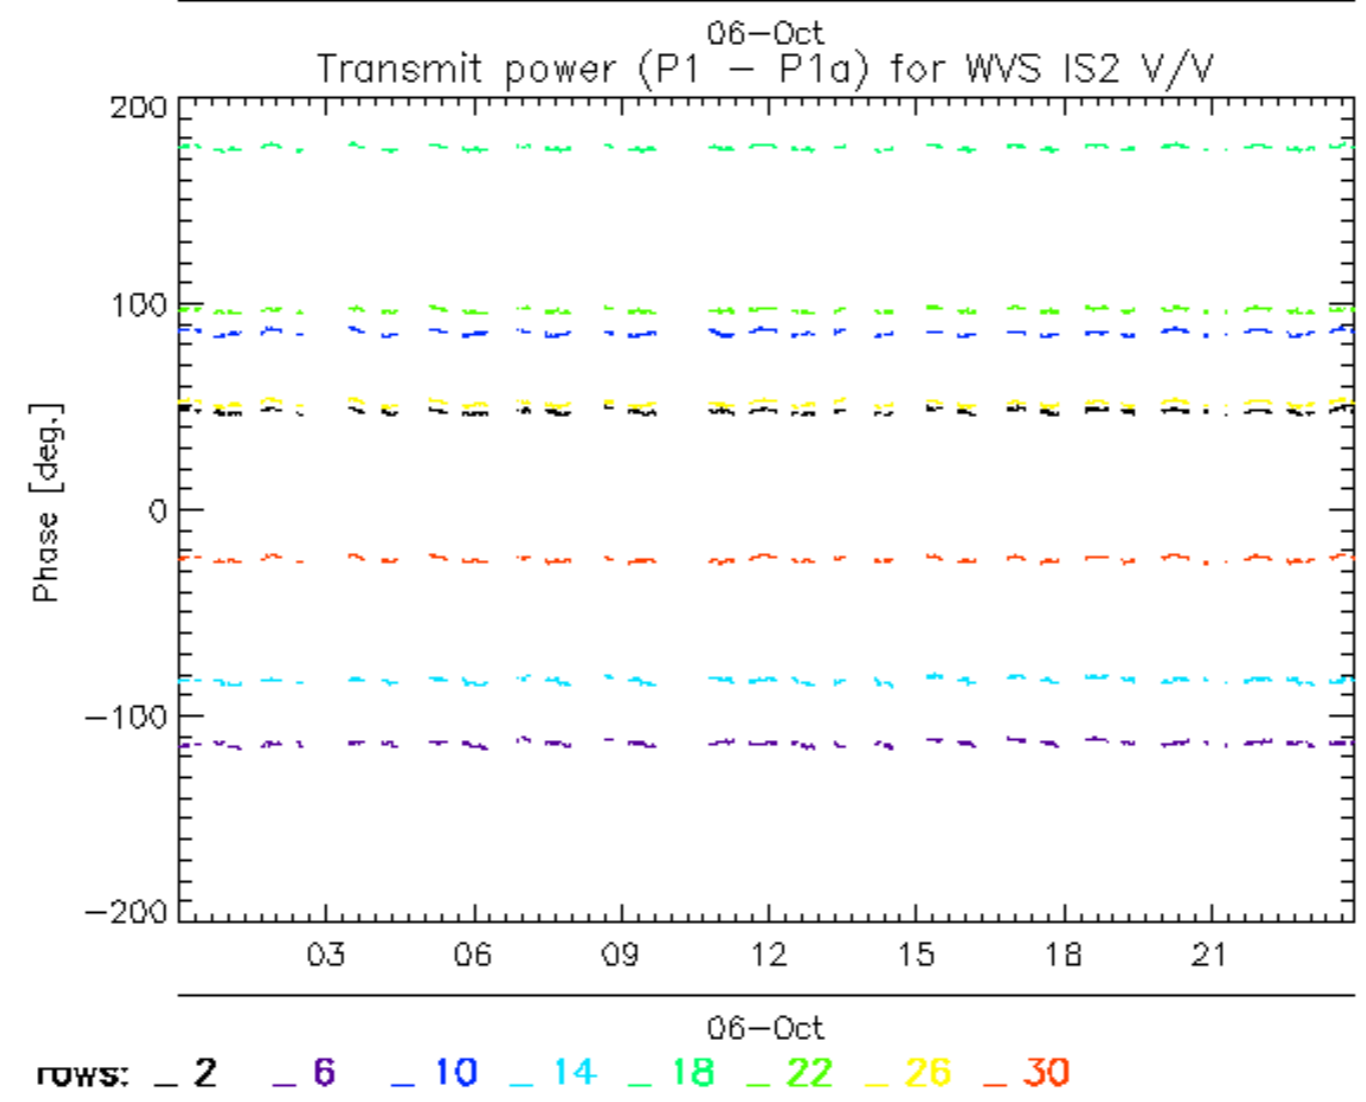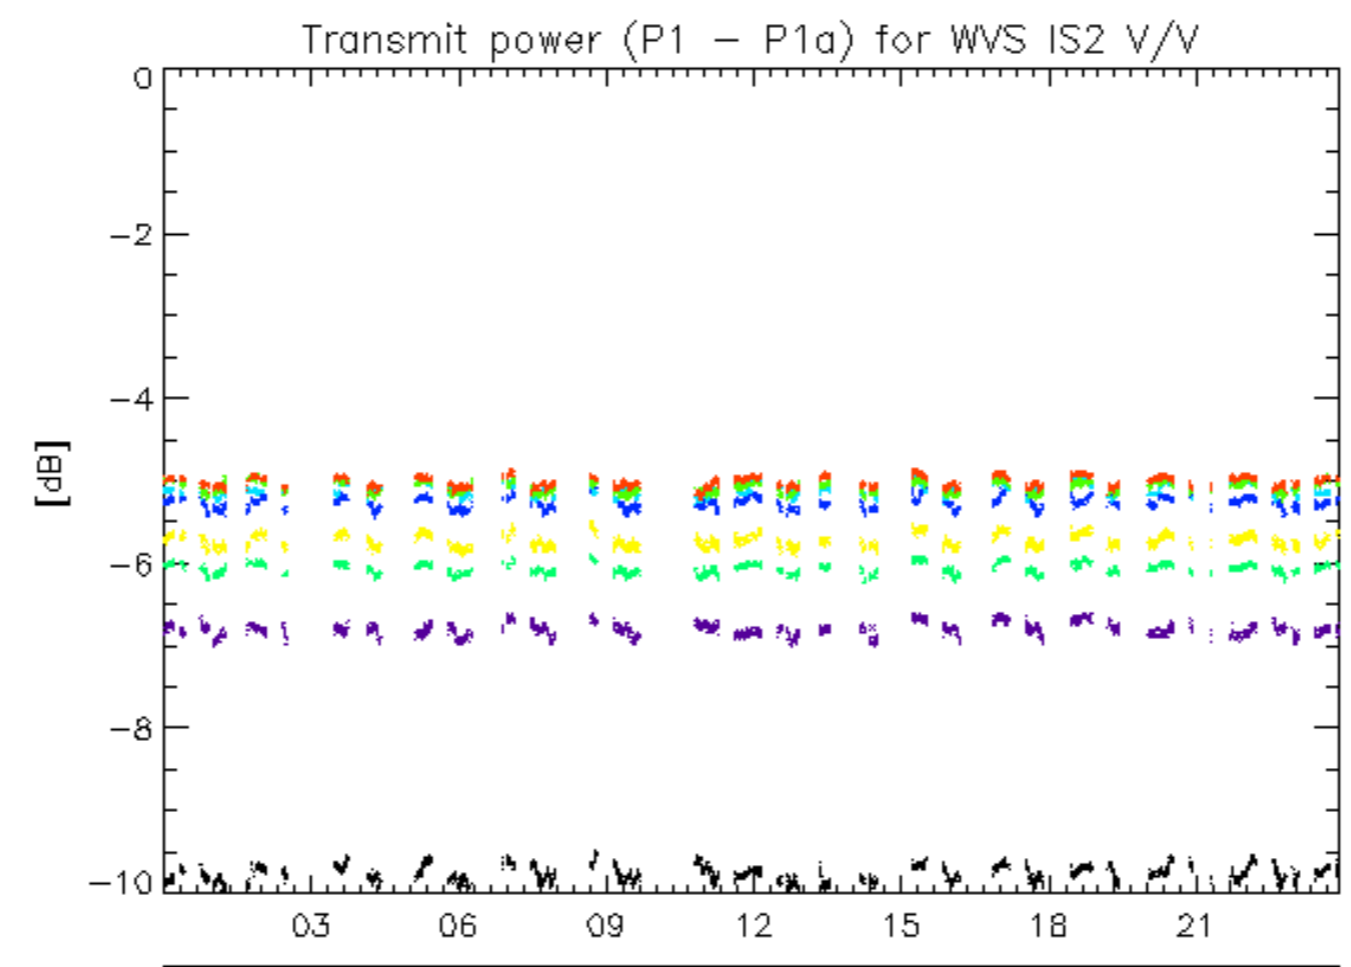


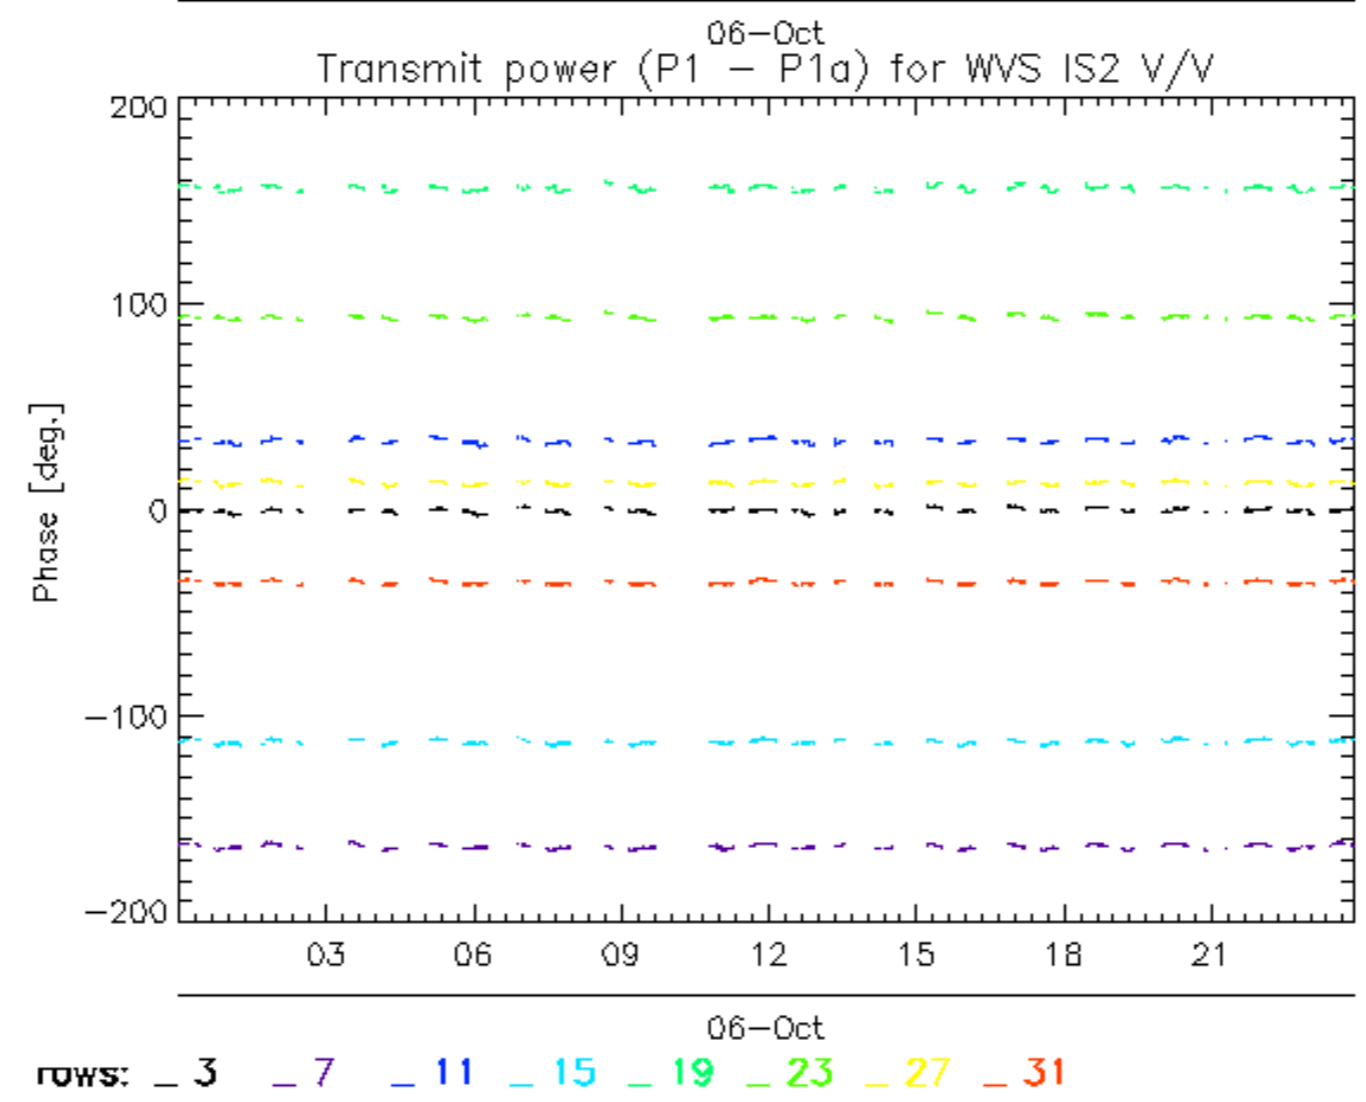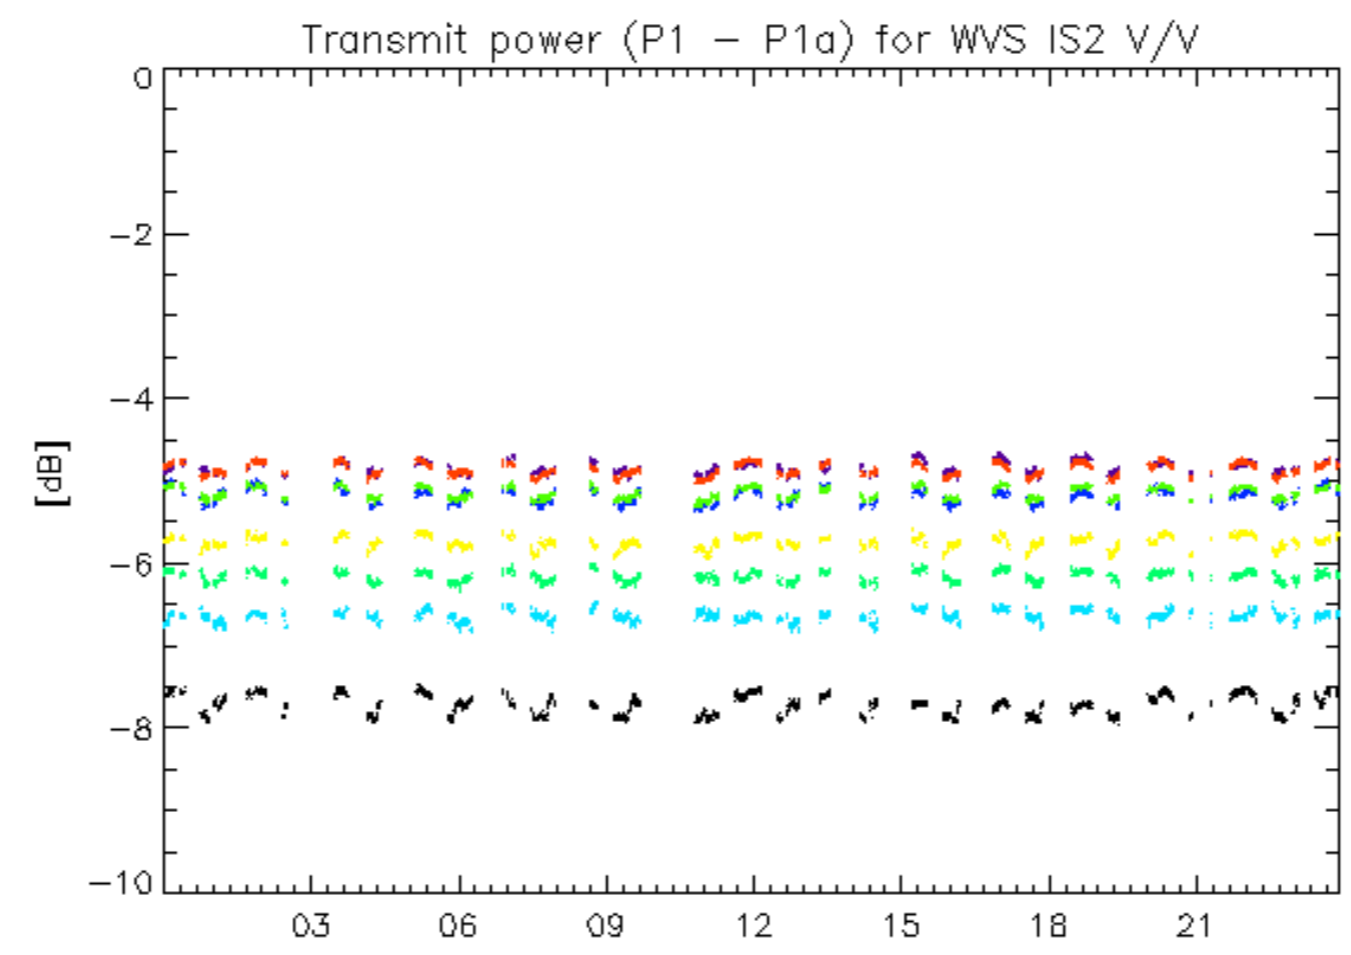


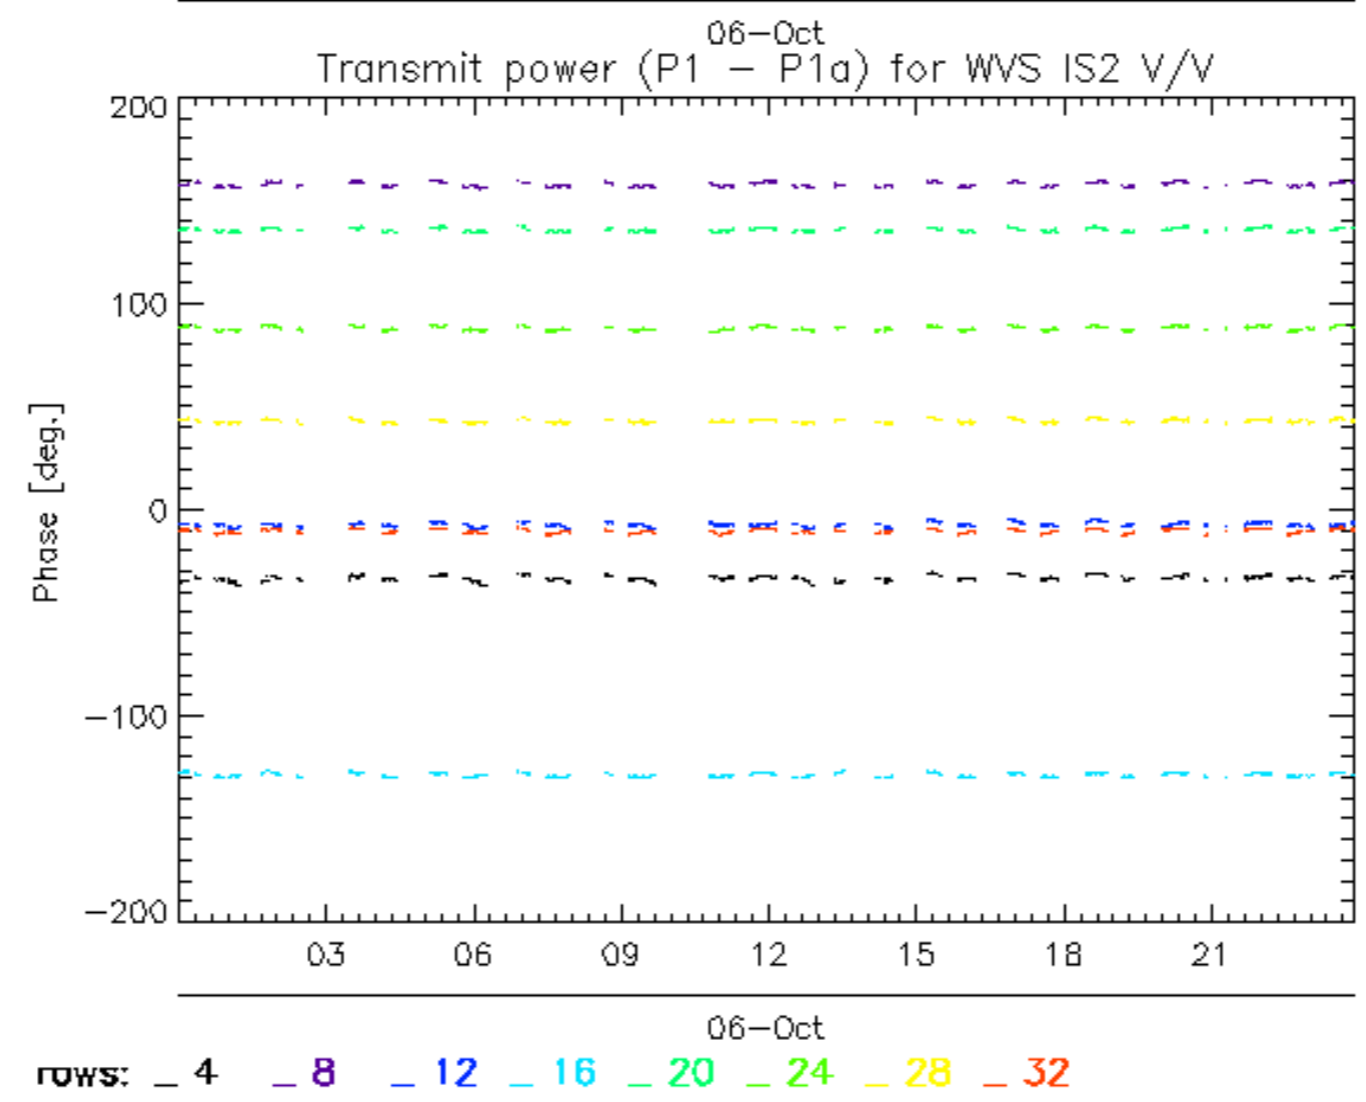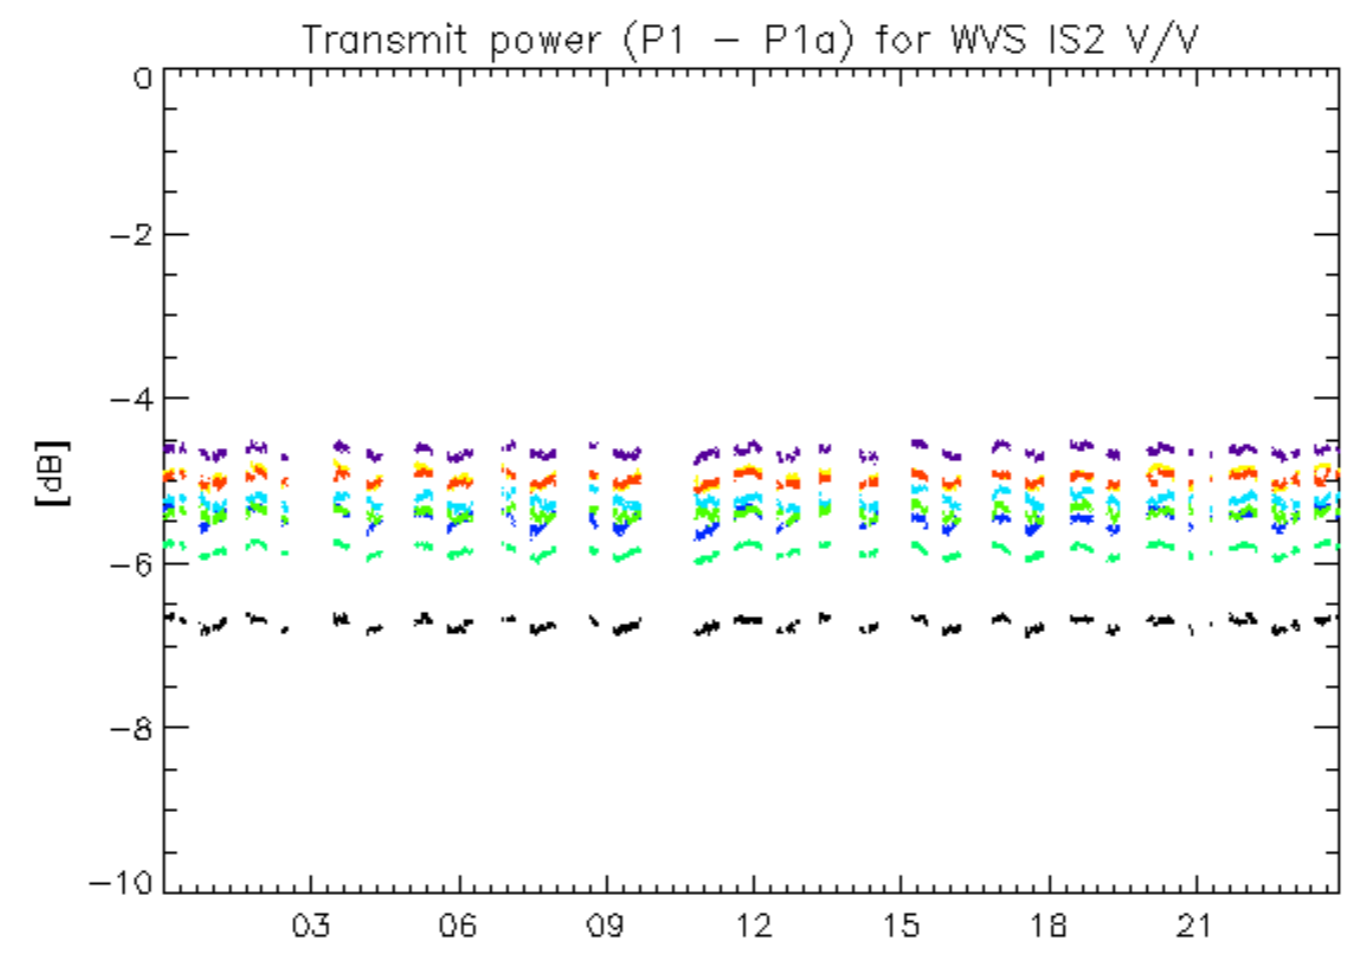

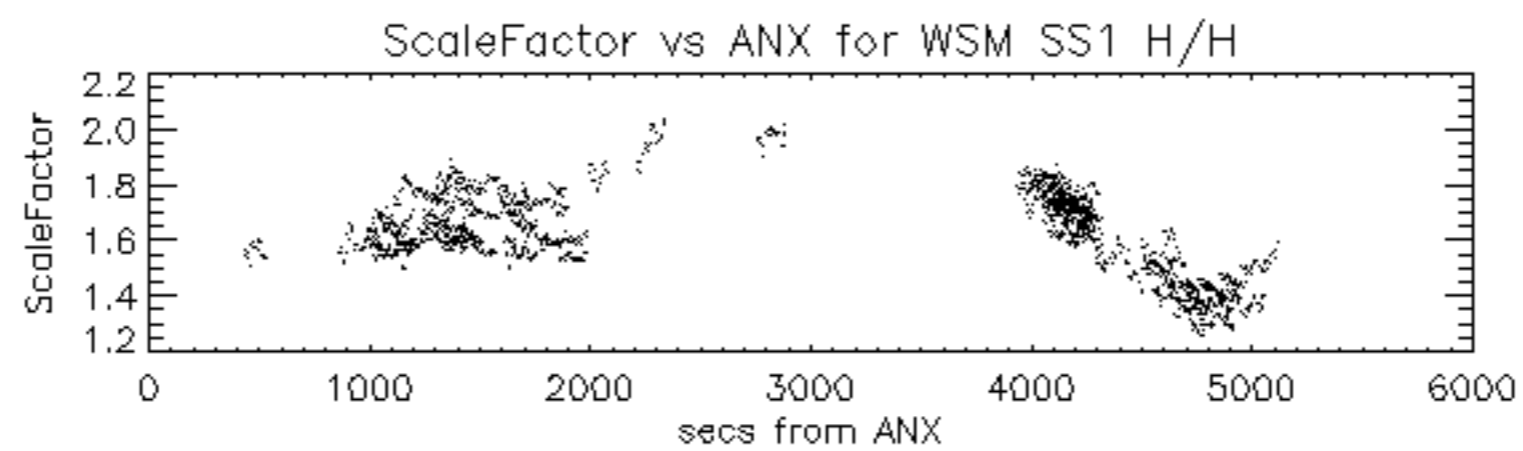

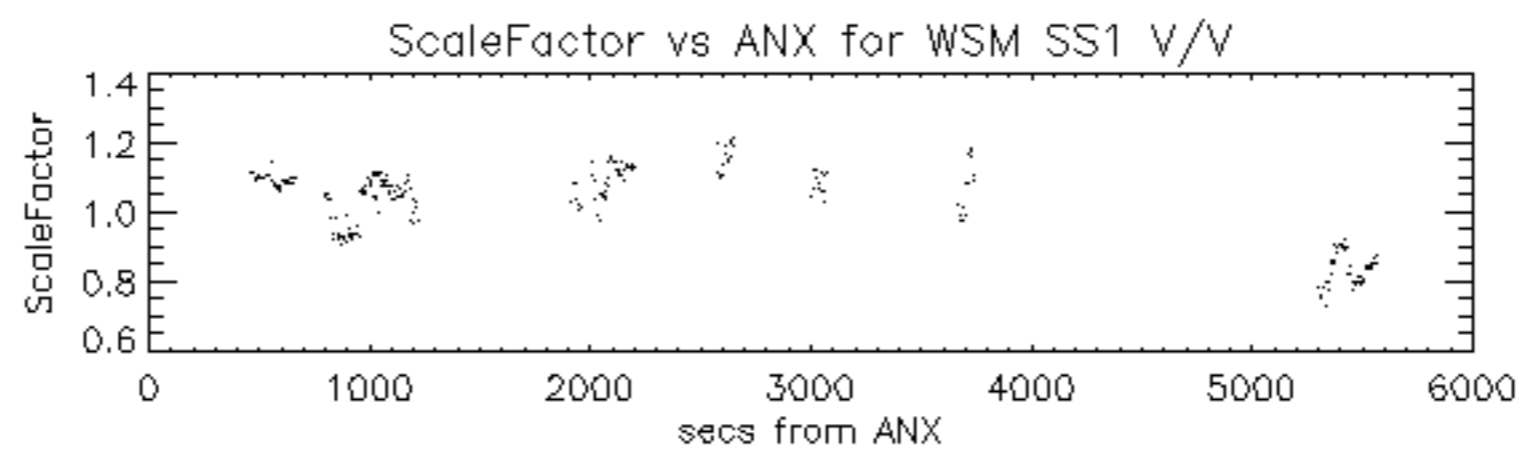

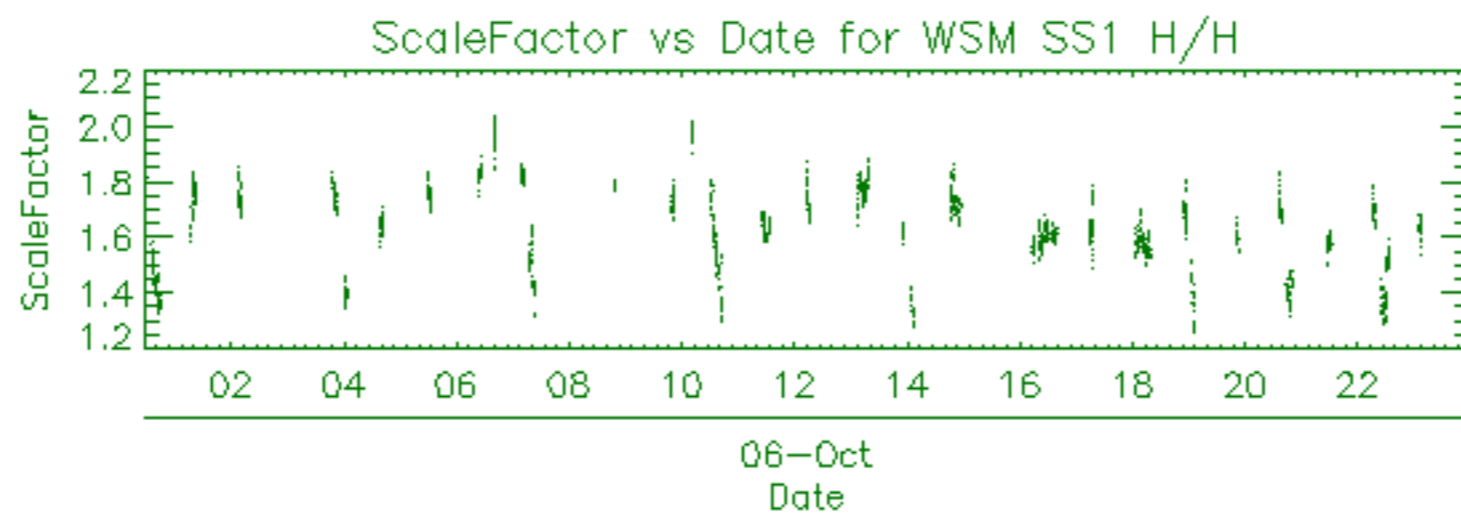

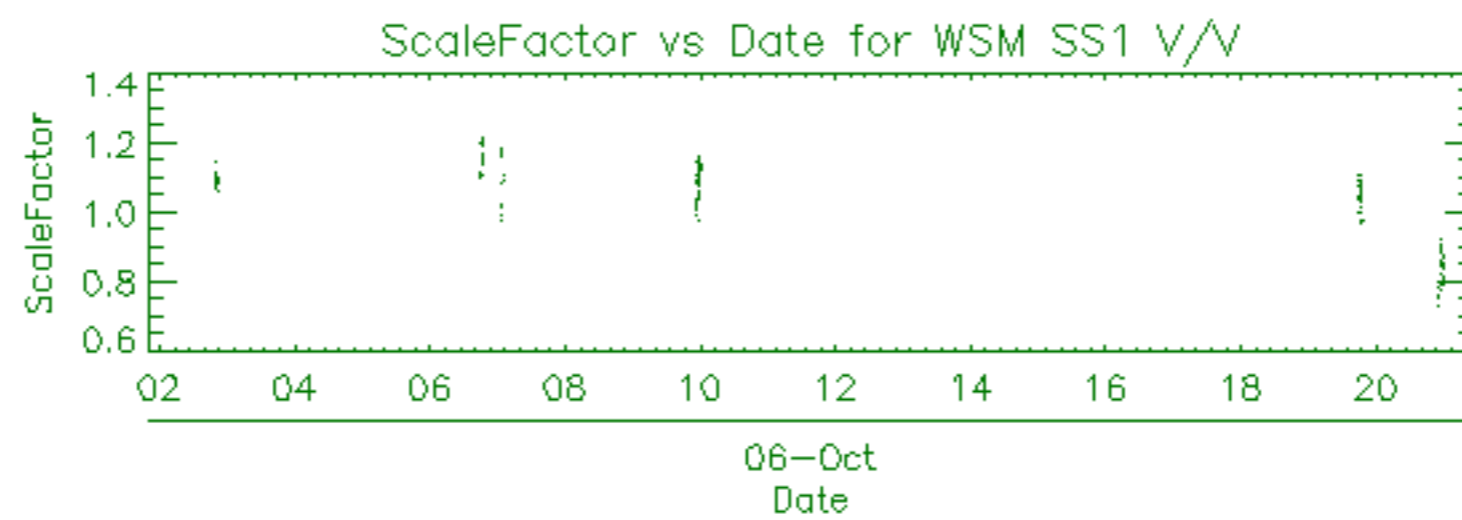

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_APM_1PNPDE20091006_014605_000000932083_00103_39736_8507.N1						IS4	H/H	83	39736	103	4.07
ASA_APM_1PNPDE20091006_032104_000000912083_00104_39737_8496.N1						IS2	H/H	83	39737	104	4.07
ASA_APM_1PNPDE20091006_032208_000000272083_00104_39737_8461.N1						IS2	***	83	39737	104	4.07

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_GM1_1PNPDE20091006_001311_000004162083_00102_39735_8320.N1						SS1	H/H	83	39735	102	4.07
ASA_GM1_1PNPDE20091006_002550_000001262083_00102_39735_8318.N1						SS1	H/H	83	39735	102	4.07
ASA_GM1_1PNPDE20091006_002959_000002952083_00102_39735_8328.N1						SS1	H/H	83	39735	102	4.07
ASA_GM1_1PNPDE20091006_005539_000002472083_00102_39735_8429.N1						SS1	H/H	83	39735	102	4.07
ASA_GM1_1PNPDE20091006_012345_000010452083_00103_39736_8481.N1						SS1	H/H	83	39736	103	4.07
ASA_GM1_1PNPDE20091006_013916_000001142083_00103_39736_8407.N1						SS1	H/H	83	39736	103	4.07
ASA_GM1_1PNPDE20091006_015650_000001022083_00103_39736_8409.N1						SS1	H/H	83	39736	103	4.07
ASA_GM1_1PNPDE20091006_021203_000007552083_00103_39736_8417.N1						SS1	H/H	83	39736	103	4.07
ASA_GM1_1PNPDE20091006_022321_000001262083_00103_39736_8465.N1						SS1	H/H	83	39736	103	4.07
ASA_GM1_1PNPDE20091006_023005_000004892083_00103_39736_8467.N1						SS1	H/H	83	39736	103	4.07
ASA_GM1_1PNPDE20091006_023943_000002652083_00103_39736_8469.N1						SS1	H/H	83	39736	103	4.07
ASA_GM1_1PNPDE20091006_025405_000004652083_00104_39737_8490.N1						SS1	H/H	83	39737	104	4.07
ASA_GM1_1PNPDE20091006_030239_000011052083_00104_39737_8509.N1						SS1	H/H	83	39737	104	4.07
ASA_GM1_1PNPDE20091006_032427_000001692083_00104_39737_8498.N1						SS1	H/H	83	39737	104	4.07
ASA_GM1_1PNPDE20091006_035233_000004412083_00104_39737_8541.N1						SS1	H/H	83	39737	104	4.07
ASA_GM1_1PNPDE20091006_040334_000002652083_00104_39737_8543.N1						SS1	H/H	83	39737	104	4.07
ASA_GM1_1PNPDE20091006_043004_000005012083_00105_39738_8545.N1						SS1	H/H	83	39738	105	4.07
ASA_GM1_1PNPDE20091006_044205_000010152083_00105_39738_8579.N1						SS1	H/H	83	39738	105	4.07
ASA_GM1_1PNPDE20091006_050331_000002352083_00105_39738_8547.N1						SS1	H/H	83	39738	105	4.07
ASA_GM1_1PNPDE20091006_053325_000007912083_00105_39738_8661.N1						SS1	H/H	83	39738	105	4.07
ASA_GM1_1PNPDE20091006_061253_000000782083_00106_39739_8706.N1						SS1	H/H	83	39739	106	4.07
ASA_GM1_1PNPDE20091006_061603_000002112083_00106_39739_8704.N1						SS1	H/H	83	39739	106	4.07
ASA_GM1_1PNPDE20091006_062116_000001442083_00106_39739_8708.N1						SS1	H/H	83	39739	106	4.07
ASA_GM1_1PNPDE20091006_062600_000007852083_00106_39739_8672.N1						SS1	H/H	83	39739	106	4.07
ASA_GM1_1PNPDE20091006_064900_000002652083_00106_39739_8718.N1						SS1	H/H	83	39739	106	4.07
ASA_GM1_1PNPDE20091006_065520_000001572083_00106_39739_8713.N1						SS1	H/H	83	39739	106	4.07
ASA_GM1_1PNPDK20091006_072416_000001812083_00106_39739_7677.N1						SS1	H/H	83	39739	106	4.07
ASA_GM1_1PNPDK20091006_075935_000006702083_00107_39740_7682.N1						SS1	H/H	83	39740	107	4.07
ASA_GM1_1PNPDK20091006_080933_000004592083_00107_39740_7727.N1						SS1	H/H	83	39740	107	4.07
ASA_GM1_1PNPDK20091006_082808_000007002083_00107_39740_7732.N1						SS1	H/H	83	39740	107	4.07
ASA_GM1_1PNPDK20091006_085135_000009732083_00107_39740_7753.N1						SS1	H/H	83	39740	107	4.07
ASA_GM1_1PNPDK20091006_090706_000000422083_00107_39740_7736.N1						SS1	H/H	83	39740	107	4.07
ASA_GM1_1PNPDK20091006_094053_000002832083_00108_39741_7738.N1						SS1	H/H	83	39741	108	4.07
ASA_GM1_1PNPDK20091006_094829_000000782083_00108_39741_7740.N1						SS1	H/H	83	39741	108	4.07
ASA_GM1_1PNPDK20091006_095238_000000722083_00108_39741_7742.N1						SS1	H/H	83	39741	108	4.07
ASA_GM1_1PNPDK20091006_104717_000000722083_00108_39741_7788.N1						SS1	H/H	83	39741	108	4.07
ASA_GM1_1PNPDK20091006_111820_000004282083_00109_39742_7790.N1						SS1	H/H	83	39742	109	4.07
ASA_GM1_1PNPDK20091006_112824_000001022083_00109_39742_7794.N1						SS1	H/H	83	39742	109	4.07
ASA_GM1_1PNPDK20091006_112854_000000902083_00109_39742_7808.N1						SS1	H/H	83	39742	109	4.07
ASA_GM1_1PNPDK20091006_113322_000001812083_00109_39742_7810.N1						SS1	H/H	83	39742	109	4.07
ASA_GM1_1PNPDK20091006_115623_000000722083_00109_39742_7815.N1						SS1	H/H	83	39742	109	4.07
ASA_GM1_1PNPDK20091006_121002_000000962083_00109_39742_7817.N1						SS1	H/H	83	39742	109	4.07
ASA_GM1_1PNPDK20091006_121628_000007552083_00109_39742_7822.N1						SS1	H/H	83	39742	109	4.07
ASA_GM1_1PNPDK20091006_123423_000003742083_00109_39742_7827.N1						SS1	H/H	83	39742	109	4.07
ASA_GM1_1PNPDK20091006_125628_000006102083_00110_39743_7832.N1						SS1	H/H	83	39743	110	4.07
ASA_GM1_1PNPDK20091006_131631_000000782083_00110_39743_7859.N1						SS1	H/H	83	39743	110	4.07
ASA_GM1_1PNPDK20091006_133317_000006702083_00110_39743_7861.N1						SS1	H/H	83	39743	110	4.07
ASA_GM1_1PNPDK20091006_134430_000006162083_00110_39743_7863.N1						SS1	H/H	83	39743	110	4.07
ASA_GM1_1PNPDK20091006_135655_000003862083_00110_39743_7865.N1						SS1	H/H	83	39743	110	4.07
ASA_GM1_1PNPDK20091006_140701_000001572083_00110_39743_7867.N1						SS1	H/H	83	39743	110	4.07
ASA_GM1_1PNPDK20091006_141544_000002652083_00110_39743_7878.N1						SS1	H/H	83	39743	110	4.07
ASA_GM1_1PNPDK20091006_143116_000008822083_00111_39744_7883.N1						SS1	H/H	83	39744	111	4.07
ASA_GM1_1PNPDK20091006_145719_000003262083_00111_39744_7910.N1						SS1	H/H	83	39744	111	4.07
ASA_GM1_1PNPDK20091006_153114_000011412083_00111_39744_7926.N1						SS1	H/H	83	39744	111	4.07
ASA_GM1_1PNPDK20091006_161131_000000902083_00112_39745_7915.N1						SS1	H/H	83	39745	112	4.07
ASA_GM1_1PNPDK20091006_161508_000003082083_00112_39745_7921.N1						SS1	H/H	83	39745	112	4.07
ASA_GM1_1PNPDK20091006_163926_000007122083_00112_39745_7958.N1						SS1	H/H	83	39745	112	4.07
ASA_GM1_1PNPDK20091006_171150_000001022083_00112_39745_7960.N1						SS1	H/H	83	39745	112	4.07
ASA_GM1_1PNPDK20091006_171831_000007372083_00112_39745_7965.N1						SS1	H/H	83	39745	112	4.07
ASA_GM1_1PNPDK20091006_175629_000004042083_00113_39746_7970.N1						SS1	H/H	83	39746	113	4.07
ASA_GM1_1PNPDK20091006_182002_000002412083_00113_39746_7997.N1						SS1	H/H	83	39746	113	4.07
ASA_GM1_1PNPDK20091006_185226_000000902083_00113_39746_7999.N1						SS1	H/H	83	39746	113	4.07
ASA_GM1_1PNPDK20091006_185839_000002352083_00113_39746_8001.N1						SS1	H/H	83	39746	113	4.07
ASA_GM1_1PNPDK20091006_190645_000002832083_00113_39746_8003.N1						SS1	H/H	83	39746	113	4.07
ASA_GM1_1PNPDK20091006_192625_000005432083_00113_39746_8008.N1						SS1	H/H	83	39746	113	4.07
ASA_GM1_1PNPDK20091006_193735_000003862083_00114_39747_8010.N1						SS1	H/H	83	39747	114	4.07
ASA_GM1_1PNPDE20091006_194748_000000962083_00114_39747_8956.N1						SS1	H/H	83	39747	114	4.07

ASA_GM1_1PNPDE20091006_195304_000004592083_00114_39747_8963.N1	SS1	H/H	83	39747	114	4.07
ASA_GM1_1PNPDE20091006_203301_000001322083_00114_39747_8961.N1	SS1	H/H	83	39747	114	4.07
ASA_GM1_1PNPDE20091006_203851_000002592083_00114_39747_8965.N1	SS1	H/H	83	39747	114	4.07
ASA_GM1_1PNPDE20091006_205027_000000962083_00114_39747_9035.N1	SS1	H/H	83	39747	114	4.07
ASA_GM1_1PNPDE20091006_210022_000010562083_00114_39747_9062.N1	SS1	H/H	83	39747	114	4.07
ASA_GM1_1PNPDE20091006_213208_000005372083_00115_39748_9060.N1	SS1	H/H	83	39748	115	4.07
ASA_GM1_1PNPDE20091006_221337_000000902083_00115_39748_9050.N1	SS1	H/H	83	39748	115	4.07
ASA_GM1_1PNPDE20091006_221909_000003382083_00115_39748_9058.N1	SS1	H/H	83	39748	115	4.07
ASA_GM1_1PNPDE20091006_224910_000003742083_00116_39749_9109.N1	SS1	H/H	83	39749	116	4.07
ASA_GM1_1PNPDE20091006_231146_000004532083_00116_39749_9104.N1	SS1	H/H	83	39749	116	4.07
ASA_GM1_1PNPDE20091006_234337_000002652083_00116_39749_9113.N1	SS1	H/H	83	39749	116	4.07
ASA_GM1_1PNPDE20091006_235413_000001142083_00116_39749_9130.N1	SS1	H/H	83	39749	116	4.07
ASA_GM1_1PNPDE20091006_235837_000000962083_00116_39749_9132.N1	SS1	H/H	83	39749	116	4.07

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20091006_023814_000000792083_00103_39736_8519.N1						IS3	H/H	83	39736	103	4.07
ASA_IMM_1PNPDE20091006_023918_000000152083_00103_39736_8477.N1						IS3	H/H	83	39736	103	4.07
ASA_IMM_1PNPDE20091006_030149_000000372083_00104_39737_8503.N1						IS3	V/V	83	39737	104	4.07
ASA_IMM_1PNPDE20091006_032238_000000982083_00104_39737_8479.N1						IS2	V/V	83	39737	104	4.07
ASA_IMM_1PNPDE20091006_045858_000002622083_00105_39738_8624.N1						IS2	V/V	83	39738	105	4.07
ASA_IMM_1PNPDE20091006_061933_000000922083_00106_39739_8626.N1						IS2	V/V	83	39739	106	4.07
ASA_IMM_1PNPDE20091006_064208_000001562083_00106_39739_8734.N1						IS2	V/V	83	39739	106	4.07
ASA_IMM_1PNPDE20091006_064746_000000632083_00106_39739_8655.N1						IS2	V/V	83	39739	106	4.07
ASA_IMM_1PNPDK20091006_075803_000000802083_00107_39740_7694.N1						IS2	V/V	83	39740	107	4.07
ASA_IMM_1PNPDK20091006_081711_000001482083_00107_39740_7713.N1						IS2	H/H	83	39740	107	4.07
ASA_IMM_1PNPDE20091006_082045_000001512083_00107_39740_8746.N1						IS2	V/V	83	39740	107	4.07
ASA_IMM_1PNPDK20091006_145500_000000372083_00111_39744_7885.N1						IS2	V/V	83	39744	111	4.07
ASA_IMM_1PNPDE20091006_150246_000000352083_00111_39744_8854.N1						IS7	H/H	83	39744	111	4.07
ASA_IMM_1PNPDK20091006_163118_000000922083_00112_39745_7946.N1						IS2	H/H	83	39745	112	4.07
ASA_IMM_1PNPDE20091006_163223_000001412083_00112_39745_8894.N1						IS2	H/H	83	39745	112	4.07
ASA_IMM_1PNPDE20091006_175410_000001262083_00113_39746_8914.N1						IS6	V/V	83	39746	113	4.07
ASA_IMM_1PNPDE20091006_175410_000000622083_00113_39746_8904.N1						IS6	V/V	83	39746	113	4.07
ASA_IMM_1PNPDE20091006_175612_000000052083_00113_39746_8908.N1						IS6	***	83	39746	113	4.07
ASA_IMM_1PNPDE20091006_182405_000000432083_00113_39746_8928.N1						IS2	V/V	83	39746	113	4.07
ASA_IMM_1PNPDE20091006_182531_000000532083_00113_39746_8930.N1						IS2	V/V	83	39746	113	4.07
ASA_IMM_1PNPDE20091006_201146_000000382083_00114_39747_9025.N1						IS5	V/V	83	39747	114	4.07
ASA_IMM_1PNPDE20091006_211940_000000302083_00115_39748_9066.N1						IS2	V/V	83	39748	115	4.07
ASA_IMM_1PNPDE20091006_214242_000000392083_00115_39748_9068.N1						IS2	V/V	83	39748	115	4.07
ASA_IMM_1PNPDK20091006_230805_000002102083_00116_39749_8076.N1						IS2	H/H	83	39749	116	4.07
ASA_IMM_1PNPDE20091006_231917_000001382083_00116_39749_9151.N1						IS2	H/H	83	39749	116	4.07
ASA_IMM_1PNPDE20091006_232120_000000152083_00116_39749_9140.N1						IS2	***	83	39749	116	4.07

Filename	Pol	Timestamp	count(Module)
ASA_MS__0PNPDK20091006_085017_000000162083_00107_39740_0891.N1	V	2009-10-06 08:50:17	320








Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion						
ASA_WSM_1PNPDE20091006_002801_000001152083_00102_39735_8336.N1						SS1	H/H	83	39735	102	4.07	
ASA_WSM_1PNPDE20091006_003458_000005742083_00102_39735_8532.N1						SS1	H/H	83	39735	102	4.07	
ASA_WSM_1PNPDE20091006_003458_000002502083_00102_39735_8488.N1						SS1	H/H	83	39735	102	4.07	
ASA_WSM_1PNPDE20091006_004307_000000612083_00102_39735_8383.N1						SS1	H/H	83	39735	102	4.07	
ASA_WSM_1PNPDE20091006_011652_000004092083_00103_39736_8766.N1						SS1	H/H	83	39736	103	4.07	
ASA_WSM_1PNPDE20091006_015035_000000912083_00103_39736_8591.N1						SS1	V/V	83	39736	103	4.07	
ASA_WSM_1PNPDE20091006_020727_000002752083_00103_39736_8463.N1						SS1	H/H	83	39736	103	4.07	
ASA_WSM_1PNPDE20091006_024848_000002192083_00104_39737_8569.N1						SS1	V/V	83	39737	104	4.07	
ASA_WSM_1PNPDE20091006_034739_000000732083_00104_39737_8608.N1						SS1	H/H	83	39737	104	4.07	
ASA_WSM_1PNPDE20091006_034739_000002872083_00104_39737_8764.N1						SS1	H/H	83	39737	104	4.07	
ASA_WSM_1PNPDE20091006_034954_000001512083_00104_39737_8653.N1						SS1	H/H	83	39737	104	4.07	
ASA_WSM_1PNPDE20091006_035150_000000362083_00104_39737_8589.N1						SS1	H/H	83	39737	104	4.07	
ASA_WSM_1PNPDE20091006_035958_000002142083_00104_39737_8596.N1						SS1	H/H	83	39737	104	4.07	
ASA_WSM_1PNPDE20091006_043829_000002142083_00105_39738_8697.N1						SS1	H/H	83	39738	105	4.07	
ASA_WSM_1PNPDE20091006_044044_000000792083_00105_39738_8651.N1						SS1	H/H	83	39738	105	4.07	
ASA_WSM_1PNPDE20091006_052849_000002692083_00105_39738_8762.N1						SS1	H/H	83	39738	105	4.07	
ASA_WSM_1PNPDE20091006_052849_000000732083_00105_39738_8598.N1						SS1	H/H	83	39738	105	4.07	
ASA_WSM_1PNPDE20091006_053104_000001332083_00105_39738_8622.N1						SS1	H/H	83	39738	105	4.07	
ASA_WSM_1PNPDE20091006_062345_000001292083_00106_39739_8687.N1						SS1	H/H	83	39739	106	4.07	
ASA_WSM_1PNPDE20091006_063908_000001532083_00106_39739_8736.N1						SS1	H/H	83	39739	106	4.07	
ASA_WSM_1PNPDE20091006_064512_000000982083_00106_39739_8744.N1						SS1	V/V	83	39739	106	4.07	
ASA_WSM_1PNPDE20091006_070326_000000922083_00106_39739_8699.N1						SS1	V/V	83	39739	106	4.07	
ASA_WSM_1PNPDE20091006_070804_000002142083_00106_39739_8732.N1						SS1	H/H	83	39739	106	4.07	
ASA_WSM_1PNPDK20091006_071719_000004162083_00106_39739_7723.N1						SS1	H/H	83	39739	106	4.07	
ASA_WSM_1PNPDK20091006_084826_000000972083_00107_39740_7776.N1						SS1	H/H	83	39740	107	4.07	
ASA_WSM_1PNPDK20091006_094712_000000612083_00108_39741_7761.N1						SS1	H/H	83	39741	108	4.07	
ASA_WSM_1PNPDK20091006_094953_000001592083_00108_39741_7774.N1						SS1	H/H	83	39741	108	4.07	
ASA_WSM_1PNPDE20091006_095521_000000732083_00108_39741_8768.N1						SS1	V/V	83	39741	108	4.07	
ASA_WSM_1PNPDK20091006_095657_000002142083_00108_39741_7778.N1						SS1	V/V	83	39741	108	4.07	
ASA_WSM_1PNPDK20091006_095657_000002142083_00108_39741_7792.N1						SS1	V/V	83	39741	108	4.07	
ASA_WSM_1PNPDE20091006_100927_000001472083_00108_39741_8780.N1						SS1	H/H	83	39741	108	4.07	
ASA_WSM_1PNPDE20091006_102933_000000922083_00108_39741_8782.N1						SS1	H/H	83	39741	108	4.07	
ASA_WSM_1PNPDE20091006_103134_000004342083_00108_39741_8808.N1						SS1	H/H	83	39741	108	4.07	
ASA_WSM_1PNPDE20091006_103824_000001772083_00108_39741_8832.N1						SS1	H/H	83	39741	108	4.07	
ASA_WSM_1PNPDE20091006_104039_000000422083_00108_39741_8830.N1						SS1	H/H	83	39741	108	4.07	
ASA_WSM_1PNPDE20091006_104201_000000982083_00108_39741_8810.N1						SS1	H/H	83	39741	108	4.07	
ASA_WSM_1PNPDE20091006_112531_000001712083_00109_39742_8822.N1						SS1	H/H	83	39742	109	4.07	
ASA_WSM_1PNPDK20091006_113102_000001342083_00109_39742_7806.N1						SS1	H/H	83	39742	109	4.07	
ASA_WSM_1PNPDE20091006_121142_000002802083_00109_39742_8824.N1						SS1	H/H	83	39742	109	4.07	
ASA_WSM_1PNPDK20091006_130641_000005872083_00110_39743_7857.N1						SS1	H/H	83	39743	110	4.07	
ASA_WSM_1PNPDE20091006_131753_000001092083_00110_39743_8860.N1						SS1	H/H	83	39743	110	4.07	
ASA_WSM_1PNPDE20091006_135450_000001212083_00110_39743_8862.N1						SS1	H/H	83	39743	110	4.07	
ASA_WSM_1PNPDE20091006_140326_000000912083_00110_39743_8882.N1						SS1	H/H	83	39743	110	4.07	
ASA_WSM_1PNPDE20091006_140527_000000912083_00110_39743_8864.N1						SS1	H/H	83	39743	110	4.07	
ASA_WSM_1PNPDK20091006_144559_000005372083_00111_39744_8032.N1						SS1	H/H	83	39744	111	4.07	
ASA_WSM_1PNPDK20091006_144559_000004342083_00111_39744_7908.N1						SS1	H/H	83	39744	111	4.07	
ASA_WSM_1PNPDK20091006_145408_000000482083_00111_39744_7906.N1						SS1	H/H	83	39744	111	4.07	
ASA_WSM_1PNPDE20091006_145545_000000912083_00111_39744_8884.N1						SS1	H/H	83	39744	111	4.07	
ASA_WSM_1PNPDE20091006_161308_000001152083_00112_39745_8874.N1						SS1	H/H	83	39745	112	4.07	
ASA_WSM_1PNPDE20091006_162017_000002382083_00112_39745_8880.N1						SS1	H/H	83	39745	112	4.07	
ASA_WSM_1PNPDK20091006_162345_000001532083_00112_39745_7954.N1						SS1	H/H	83	39745	112	4.07	
ASA_WSM_1PNPDK20091006_162641_000002512083_00112_39745_7956.N1						SS1	H/H	83	39745	112	4.07	
ASA_WSM_1PNPDE20091006_163454_000002512083_00112_39745_8916.N1						SS1	H/H	83	39745	112	4.07	
ASA_WSM_1PNPDE20091006_163607_000000612083_00112_39745_8898.N1						SS1	H/H	83	39745	112	4.07	
ASA_WSM_1PNPDE20091006_163804_000000612083_00112_39745_8902.N1						SS1	H/H	83	39745	112	4.07	
ASA_WSM_1PNPDE20091006_171338_000002872083_00112_39745_9023.N1						SS1	H/H	83	39745	112	4.07	
ASA_WSM_1PNPDK20091006_180317_000005872083_00113_39746_7995.N1						SS1	H/H	83	39746	113	4.07	
ASA_WSM_1PNPDE20091006_181323_000001212083_00113_39746_8926.N1						SS1	H/H	83	39746	113	4.07	
ASA_WSM_1PNPDE20091006_181411_000001902083_00113_39746_9027.N1						SS1	H/H	83	39746	113	4.07	
ASA_WSM_1PNPDE20091006_181411_000003482083_00113_39746_9033.N1						SS1	H/H	83	39746	113	4.07	
ASA_WSM_1PNPDE20091006_181822_000000962083_00113_39746_9028.N1						SS1	H/H	83	39746	113	4.07	
ASA_WSM_1PNPDE20091006_185403_000002692083_00113_39746_8989.N1						SS1	H/H	83	39746	113	4.07	
ASA_WSM_1PNPDE20091006_190241_000002382083_00113_39746_8954.N1						SS1	H/H	83	39746	113	4.07	
ASA_WSM_1PNPDK20091006_194407_000002202083_00114_39747_8034.N1						SS1	V/V	83	39747	114	4.07	
ASA_WSM_1PNPDK20091006_194932_000001892083_00114_39747_8036.N1						SS1	H/H	83	39747	114	4.07	
ASA_WSM_1PNPDE20091006_203516_000001892083_00114_39747_9064.N1						SS1	H/H	83	39747	114	4.07	
ASA_WSM_1PNPDE20091006_203516_000002072083_00114_39747_9070.N1						SS1	H/H	83	39747	114	4.07	


ASA_WSM_1PNPDE20091006_204317_000001702083_00114_39747_9031.N1	SS1	H/H	83	39747	114	4.07
ASA_WSM_1PNPDE20091006_204317_000001342083_00114_39747_9021.N1	SS1	H/H	83	39747	114	4.07
ASA_WSM_1PNPDE20091006_204622_000002442083_00114_39747_9095.N1	SS1	H/H	83	39747	114	4.07
ASA_WSM_1PNPDE20091006_204735_000001702083_00114_39747_9075.N1	SS1	H/H	83	39747	114	4.07
ASA_WSM_1PNPDE20091006_205523_000002932083_00114_39747_9093.N1	SS1	V/V	83	39747	114	4.07
ASA_WSM_1PNPDE20091006_205737_000000552083_00114_39747_9013.N1	SS1	V/V	83	39747	114	4.07
ASA_WSM_1PNPDK20091006_212055_000003052083_00115_39748_8058.N1	SS1	V/V	83	39748	115	4.07
ASA_WSM_1PNPDK20091006_212649_000003122083_00115_39748_8060.N1	SS1	H/H	83	39748	115	4.07
ASA_WSM_1PNPDE20091006_221512_000002312083_00115_39748_9264.N1	SS1	H/H	83	39748	115	4.07
ASA_WSM_1PNPDE20091006_221726_000000972083_00115_39748_9238.N1	SS1	H/H	83	39748	115	4.07
ASA_WSM_1PNPDE20091006_222453_000003122083_00115_39748_9149.N1	SS1	H/H	83	39748	115	4.07
ASA_WSM_1PNPDE20091006_222453_000004892083_00115_39748_9211.N1	SS1	H/H	83	39748	115	4.07
ASA_WSM_1PNPDK20091006_230505_000001702083_00116_39749_8078.N1	SS1	H/H	83	39749	116	4.07
ASA_WSM_1PNPDE20091006_235612_000001352083_00116_39749_9153.N1	SS1	H/H	83	39749	116	4.07




Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20091005_235555_000009892083_00102_39735_8323.N1						IS2	V/V	83	39735	102	4.07
ASA_WVS_1PNPDE20091006_002009_000003002083_00102_39735_8326.N1						IS2	V/V	83	39735	102	4.07
ASA_WVS_1PNPDE20091006_004444_000002402083_00102_39735_8334.N1						IS2	V/V	83	39735	102	4.07
ASA_WVS_1PNPDE20091006_004759_000004192083_00102_39735_8392.N1						IS2	V/V	83	39735	102	4.07
ASA_WVS_1PNPDE20091006_005949_000009442083_00102_39735_8447.N1						IS2	V/V	83	39735	102	4.07
ASA_WVS_1PNPDE20091006_014110_000001642083_00103_39736_8400.N1						IS2	V/V	83	39736	103	4.07
ASA_WVS_1PNPDE20091006_014745_000001192083_00103_39736_8403.N1						IS2	V/V	83	39736	103	4.07
ASA_WVS_1PNPDE20091006_015206_000002392083_00103_39736_8425.N1						IS2	V/V	83	39736	103	4.07
ASA_WVS_1PNPDE20091006_015832_000004352083_00103_39736_8415.N1						IS2	V/V	83	39736	103	4.07
ASA_WVS_1PNPDE20091006_022529_000002402083_00103_39736_8486.N1						IS2	V/V	83	39736	103	4.07
ASA_WVS_1PNPDE20091006_032717_000008392083_00104_39737_8501.N1						IS2	V/V	83	39737	104	4.07
ASA_WVS_1PNPDE20091006_034102_000002102083_00104_39737_8539.N1						IS2	V/V	83	39737	104	4.07
ASA_WVS_1PNPDE20091006_040802_000010042083_00104_39737_8550.N1						IS2	V/V	83	39737	104	4.07
ASA_WVS_1PNPDE20091006_050727_000009142083_00105_39738_8553.N1						IS2	V/V	83	39738	105	4.07
ASA_WVS_1PNPDE20091006_052226_000002702083_00105_39738_8639.N1						IS2	V/V	83	39738	105	4.07
ASA_WVS_1PNPDE20091006_054641_000015292083_00105_39738_8670.N1						IS2	V/V	83	39738	105	4.07
ASA_WVS_1PNPDE20091006_061415_000000592083_00106_39739_8716.N1						IS2	V/V	83	39739	106	4.07
ASA_WVS_1PNPDE20091006_065326_000000742083_00106_39739_8730.N1						IS2	V/V	83	39739	106	4.07
ASA_WVS_1PNPDE20091006_065801_000002842083_00106_39739_8711.N1						IS2	V/V	83	39739	106	4.07
ASA_WVS_1PNPDK20091006_070456_000001502083_00106_39739_7675.N1						IS2	V/V	83	39739	106	4.07
ASA_WVS_1PNPDK20091006_072717_000018142083_00106_39739_7680.N1						IS2	V/V	83	39739	106	4.07
ASA_WVS_1PNPDK20091006_083949_000004802083_00107_39740_7730.N1						IS2	V/V	83	39740	107	4.07
ASA_WVS_1PNPDK20091006_090753_000019342083_00107_39740_7745.N1						IS2	V/V	83	39740	107	4.07
ASA_WVS_1PNPDK20091006_104829_000017542083_00108_39741_7797.N1						IS2	V/V	83	39741	108	4.07
ASA_WVS_1PNPDK20091006_113625_000011542083_00109_39742_7813.N1						IS2	V/V	83	39742	109	4.07
ASA_WVS_1PNPDK20091006_115736_000007042083_00109_39742_7820.N1						IS2	V/V	83	39742	109	4.07
ASA_WVS_1PNPDK20091006_122904_000002702083_00109_39742_7825.N1						IS2	V/V	83	39742	109	4.07
ASA_WVS_1PNPDK20091006_124039_000009032083_00109_39742_7830.N1						IS2	V/V	83	39742	109	4.07
ASA_WVS_1PNPDK20091006_131939_000007792083_00110_39743_7870.N1						IS2	V/V	83	39743	110	4.07
ASA_WVS_1PNPDK20091006_140940_000003152083_00110_39743_7873.N1						IS2	V/V	83	39743	110	4.07
ASA_WVS_1PNPDK20091006_142012_000001942083_00110_39743_7876.N1						IS2	V/V	83	39743	110	4.07
ASA_WVS_1PNPDK20091006_142536_000002992083_00111_39744_7881.N1						IS2	V/V	83	39744	111	4.07
ASA_WVS_1PNPDK20091006_151254_000010492083_00111_39744_7913.N1						IS2	V/V	83	39744	111	4.07
ASA_WVS_1PNPDK20091006_155016_000012292083_00111_39744_7924.N1						IS2	V/V	83	39744	111	4.07
ASA_WVS_1PNPDK20091006_165118_000011842083_00112_39745_7963.N1						IS2	V/V	83	39745	112	4.07
ASA_WVS_1PNPDK20091006_173052_000013042083_00112_39745_7968.N1						IS2	V/V	83	39745	112	4.07
ASA_WVS_1PNPDK20091006_182630_000015142083_00113_39746_8006.N1						IS2	V/V	83	39746	113	4.07
ASA_WVS_1PNPDK20091006_191128_000008542083_00113_39746_8013.N1						IS2	V/V	83	39746	113	4.07
ASA_WVS_1PNPDE20091006_200047_000006142083_00114_39747_8959.N1						IS2	V/V	83	39747	114	4.07
ASA_WVS_1PNPDE20091006_201230_000011842083_00114_39747_8968.N1						IS2	V/V	83	39747	114	4.07
ASA_WVS_1PNPDE20091006_205204_000001502083_00114_39747_9038.N1						IS2	V/V	83	39747	114	4.07
ASA_WVS_1PNPDE20091006_211759_000000442083_00115_39748_9048.N1						IS2	V/V	83	39748	115	4.07
ASA_WVS_1PNPDE20091006_214110_000000602083_00115_39748_9045.N1						IS2	V/V	83	39748	115	4.07
ASA_WVS_1PNPDE20091006_214326_000017692083_00115_39748_9053.N1						IS2	V/V	83	39748	115	4.07
ASA_WVS_1PNPDE20091006_223313_000002242083_00115_39748_9056.N1						IS2	V/V	83	39748	115	4.07
ASA_WVS_1PNPDE20091006_223613_000007342083_00115_39748_9102.N1						IS2	V/V	83	39748	115	4.07
ASA_WVS_1PNPDE20091006_223313_000002242083_00115_39748_9056.N1						IS1	V/V	83	39748	115	4.07
ASA_WVS_1PNPDE20091006_225658_000004492083_00116_39749_9107.N1						IS2	V/V	83	39749	116	4.07
ASA_WVS_1PNPDE20091006_232316_000011692083_00116_39749_9123.N1						IS2	V/V	83	39749	116	4.07
ASA_WVS_1PNPDE20091006_234941_000002252083_00116_39749_9118.N1						IS2	V/V	83	39749	116	4.07



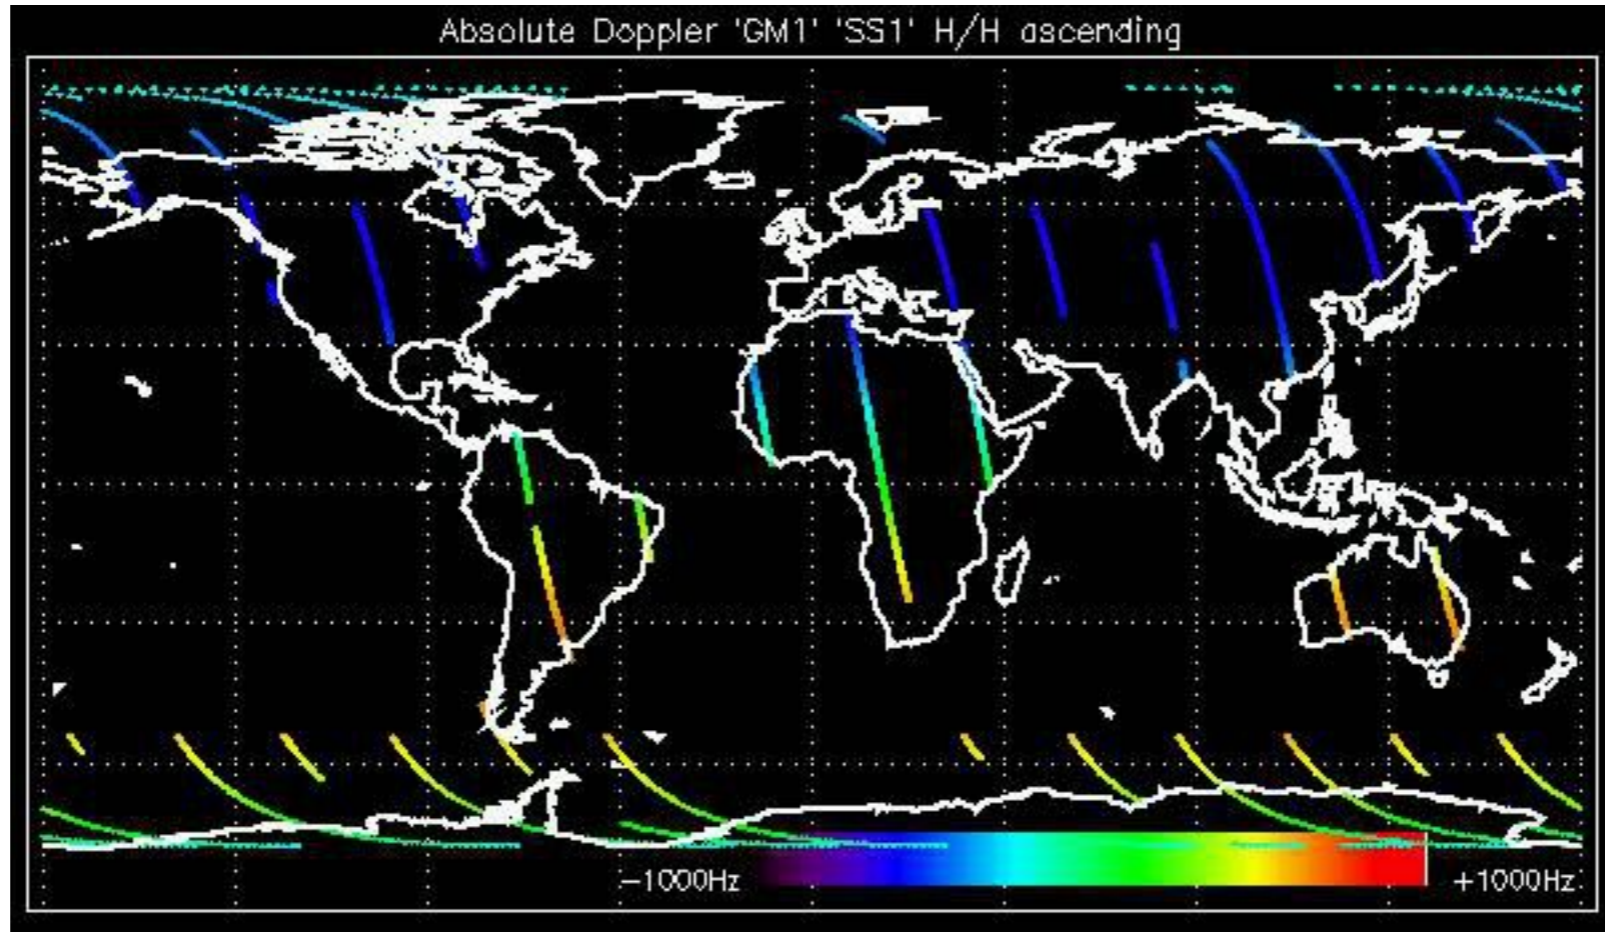


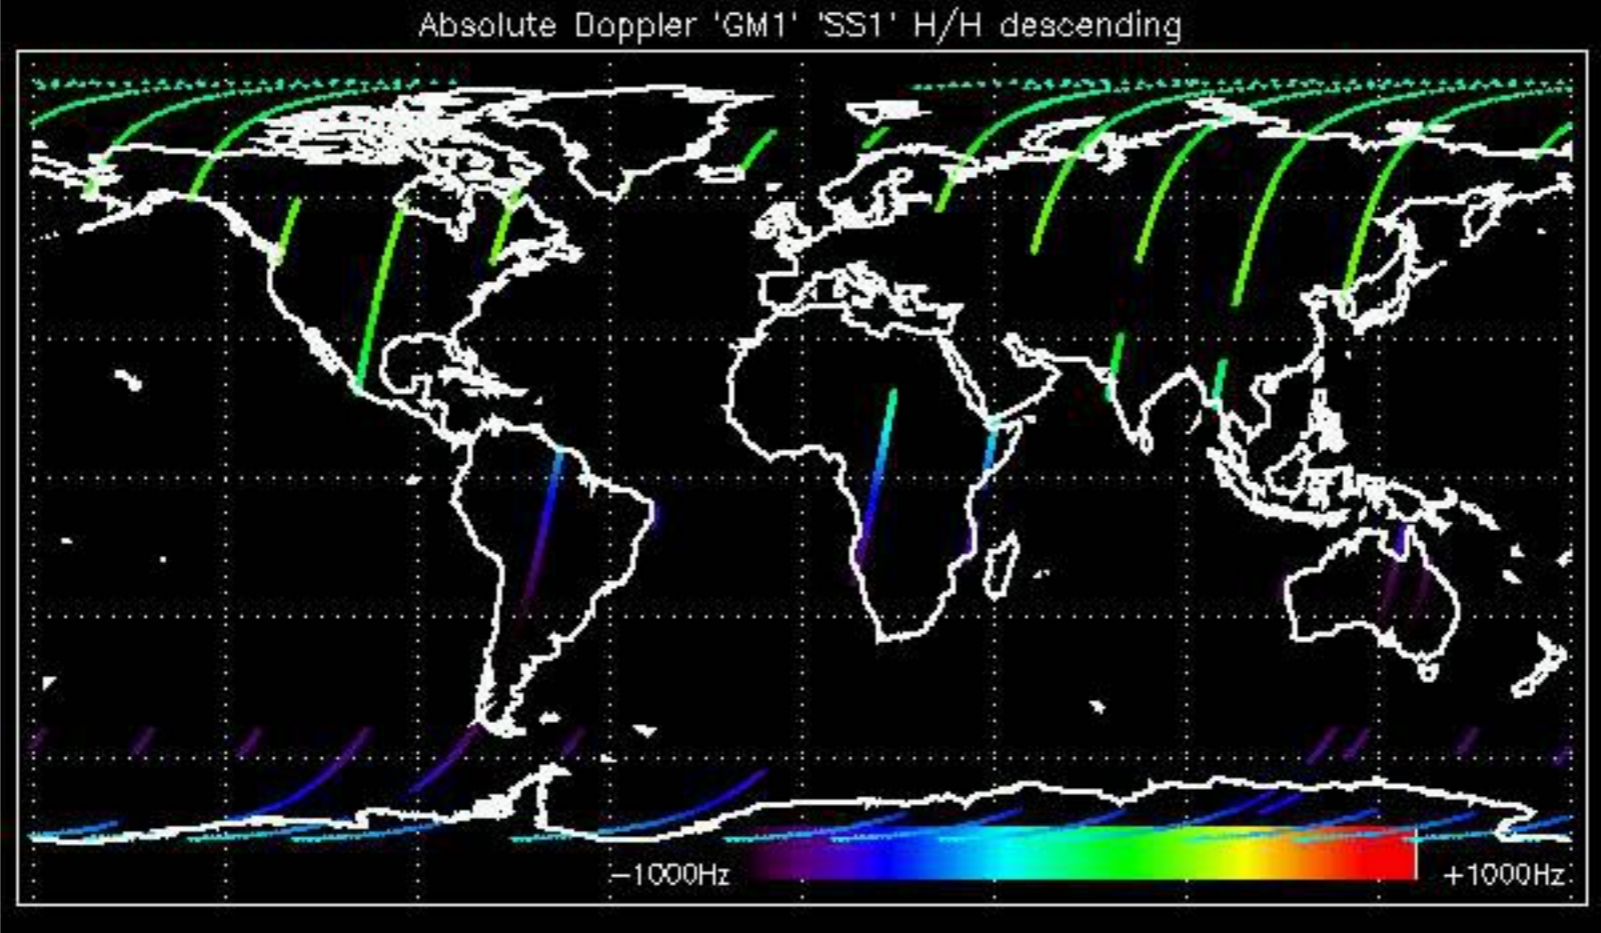


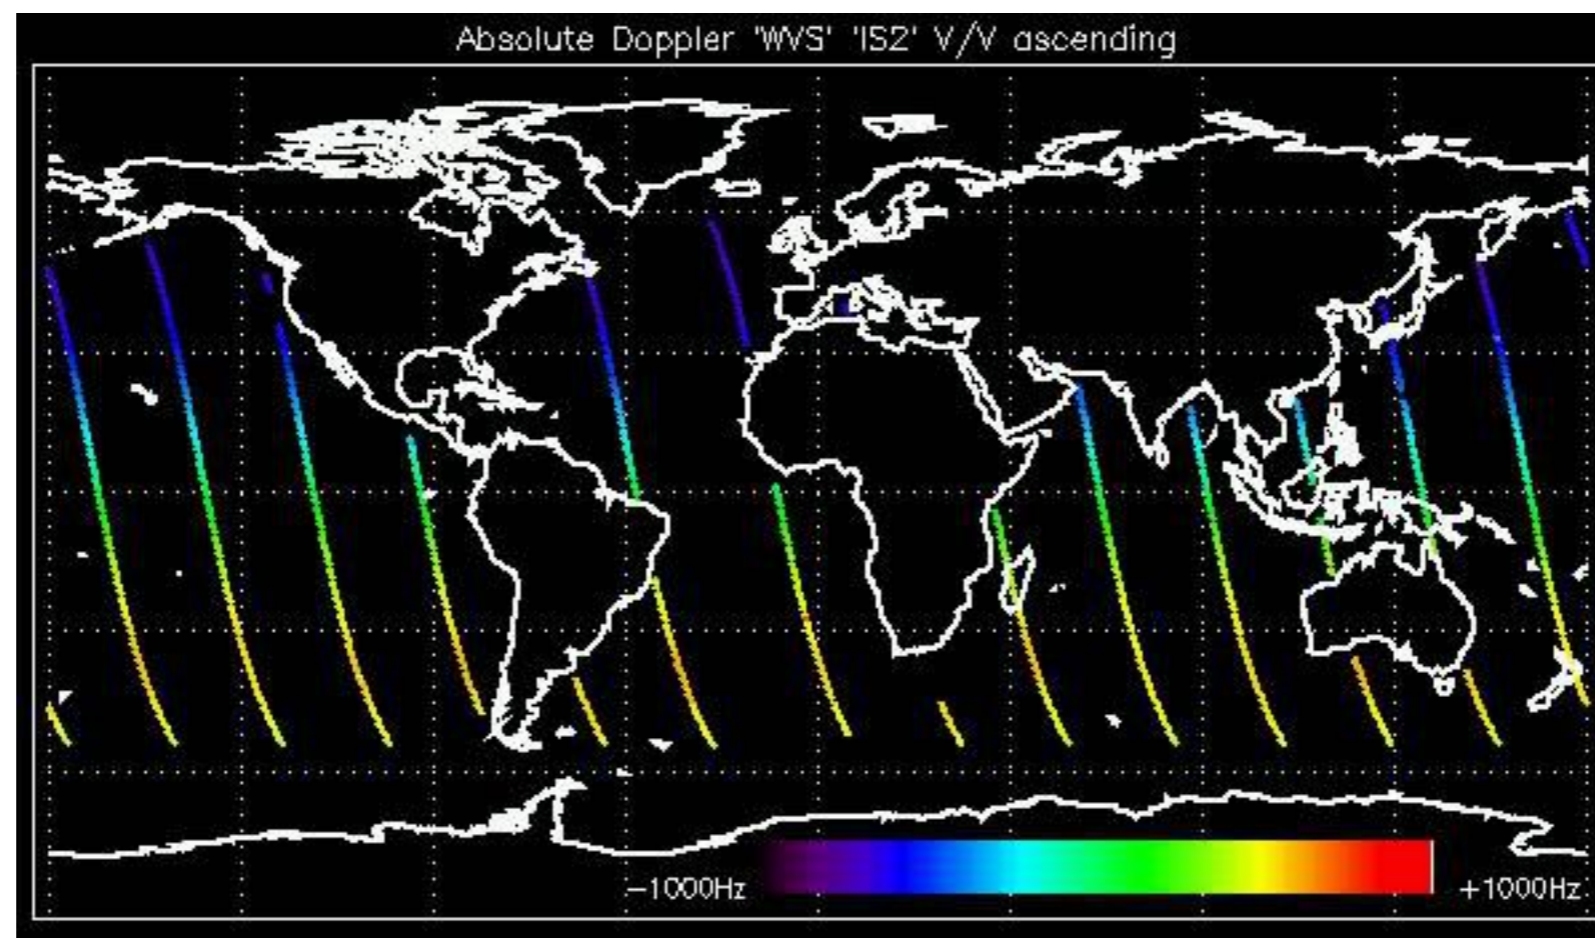


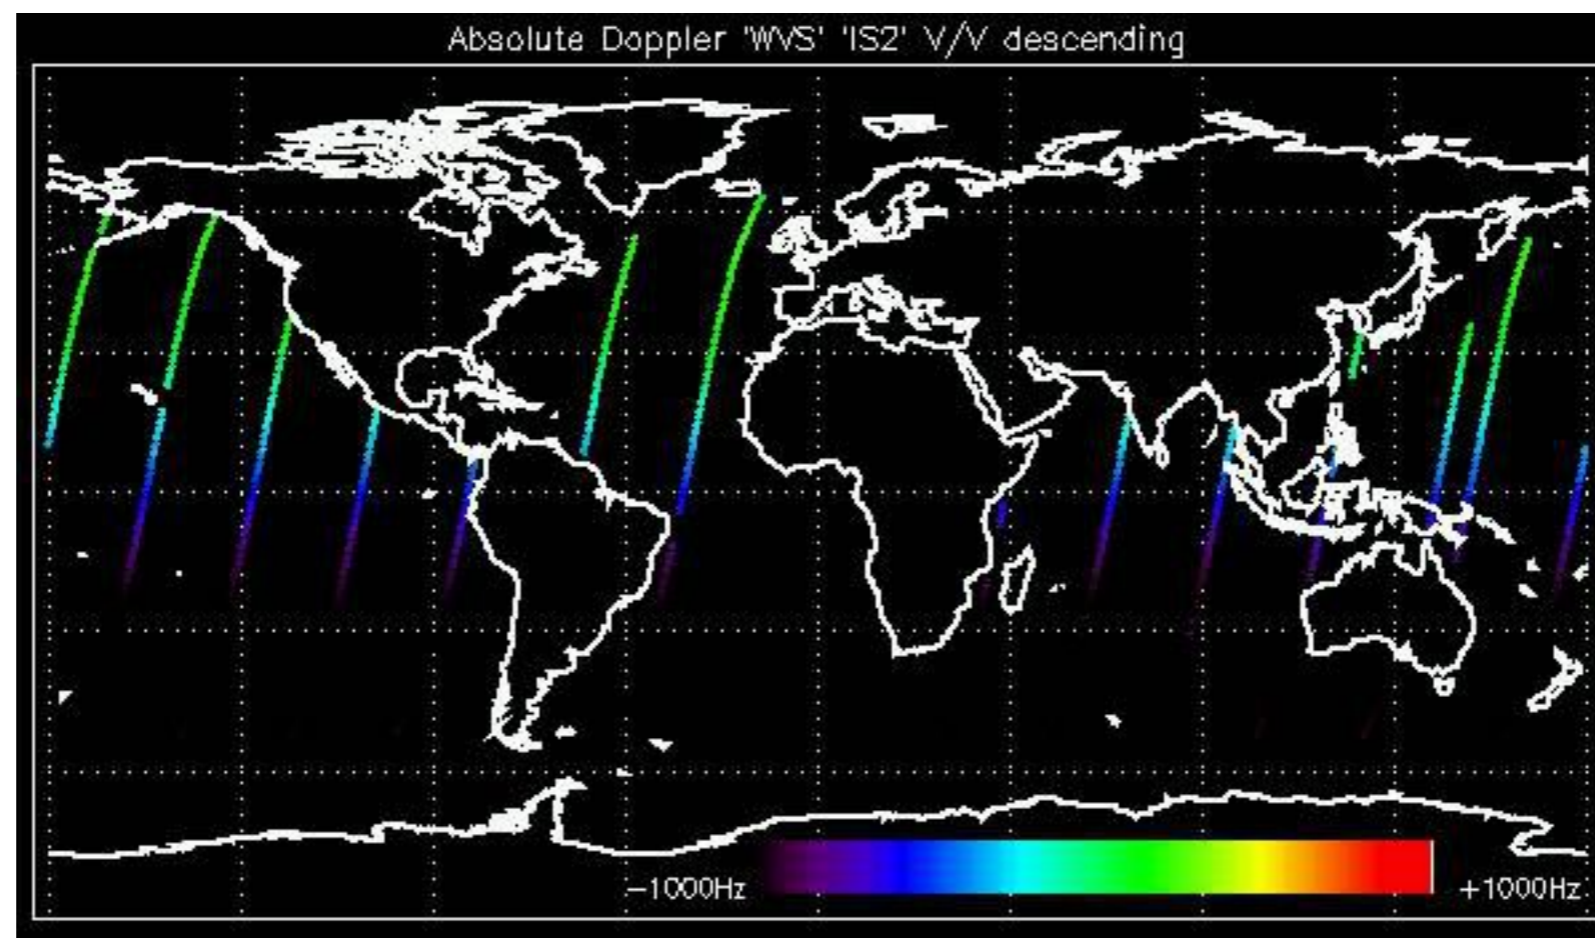


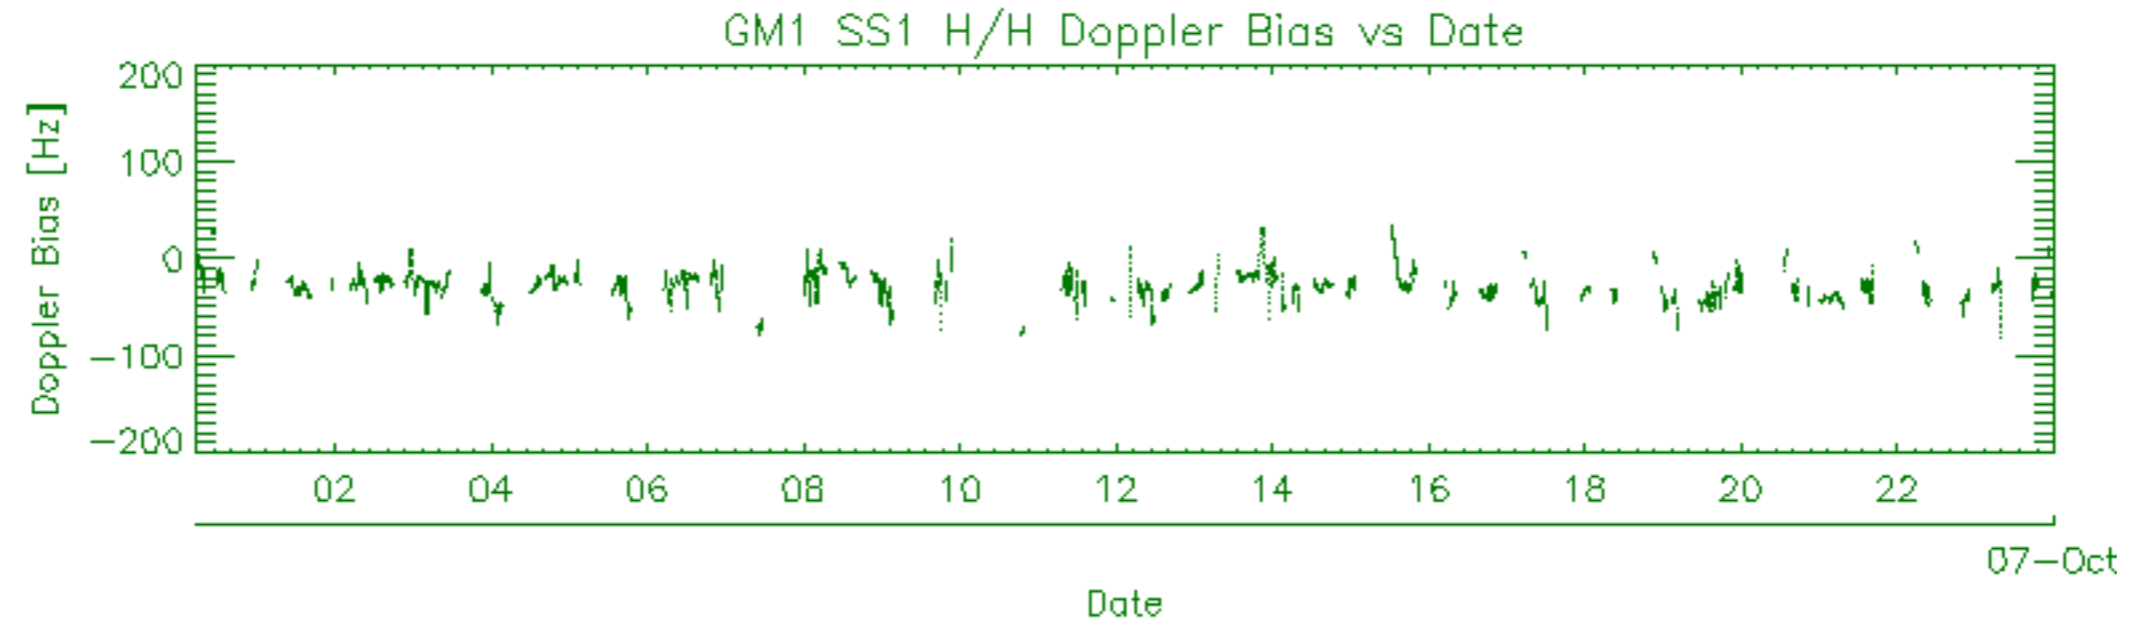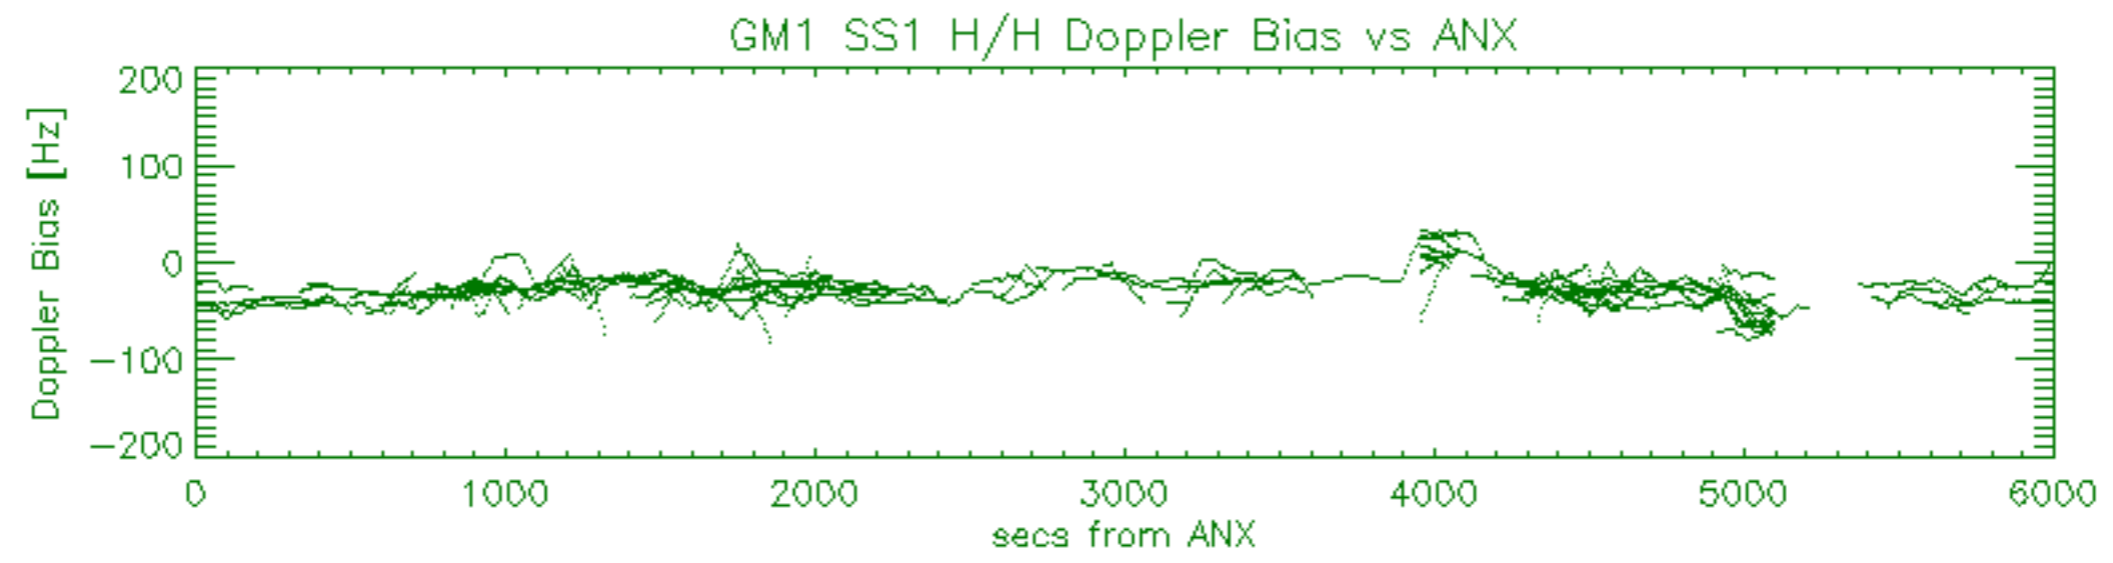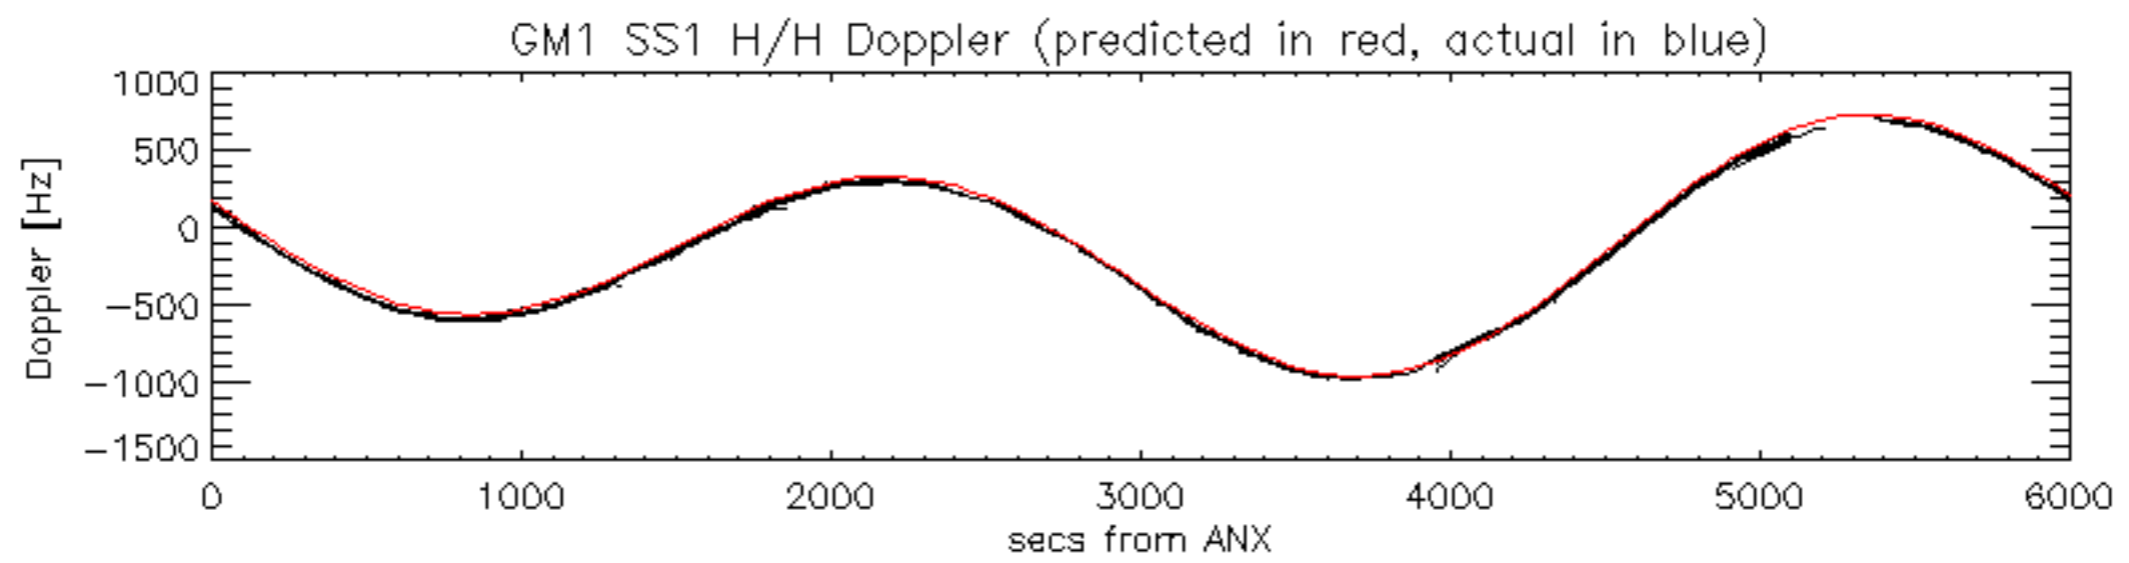



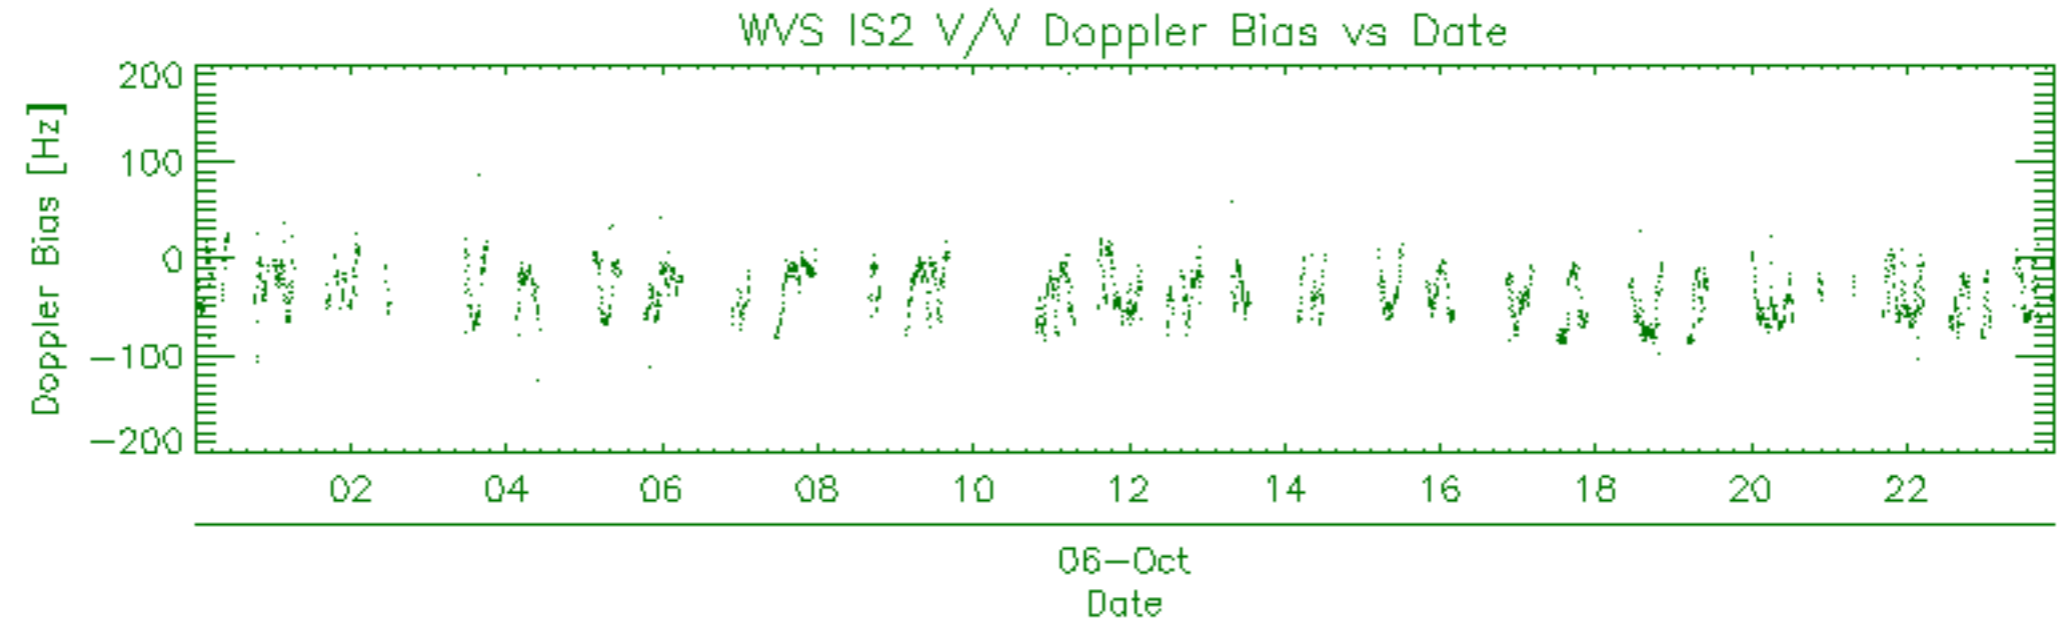
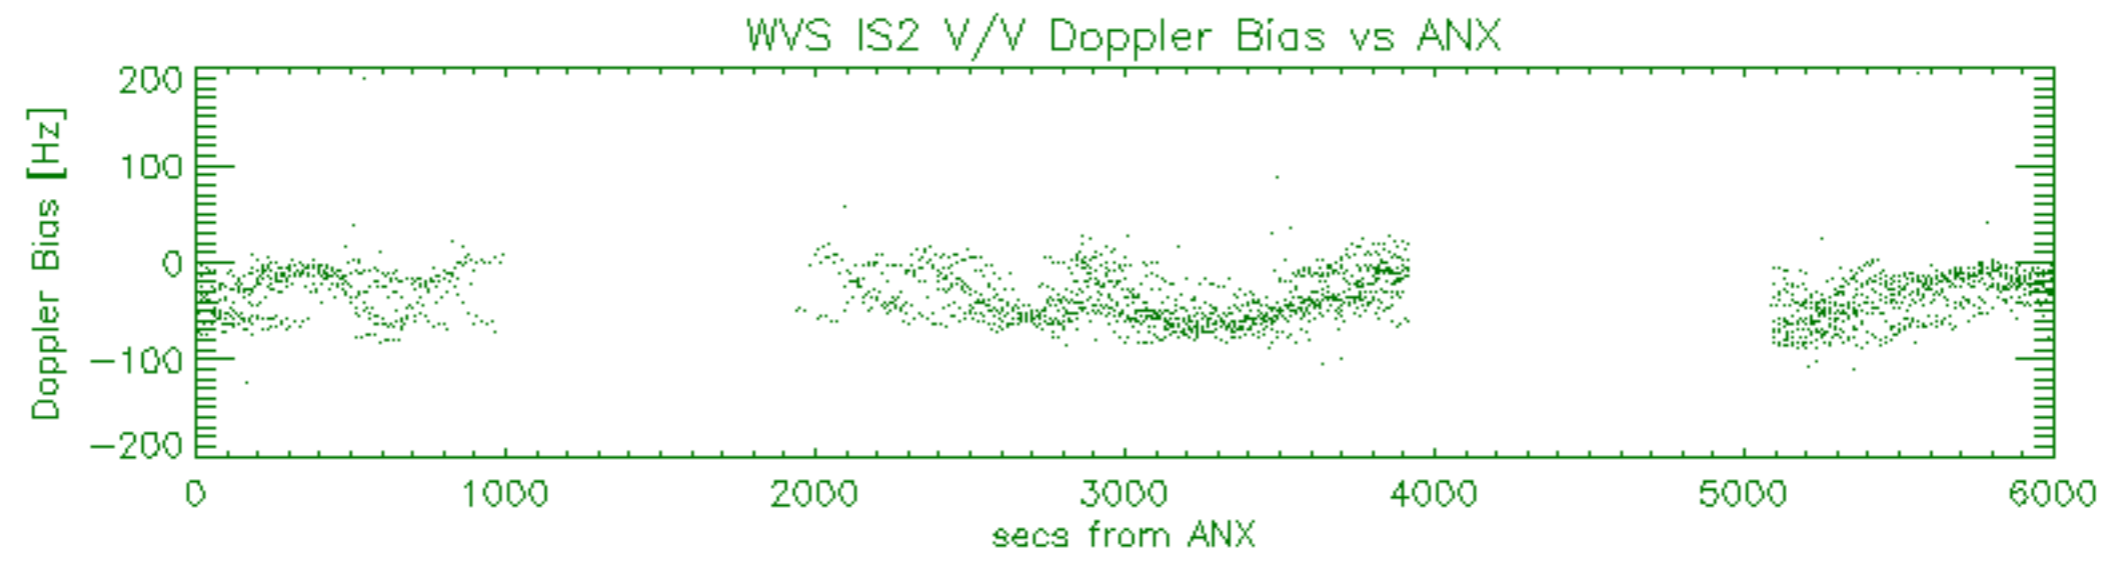
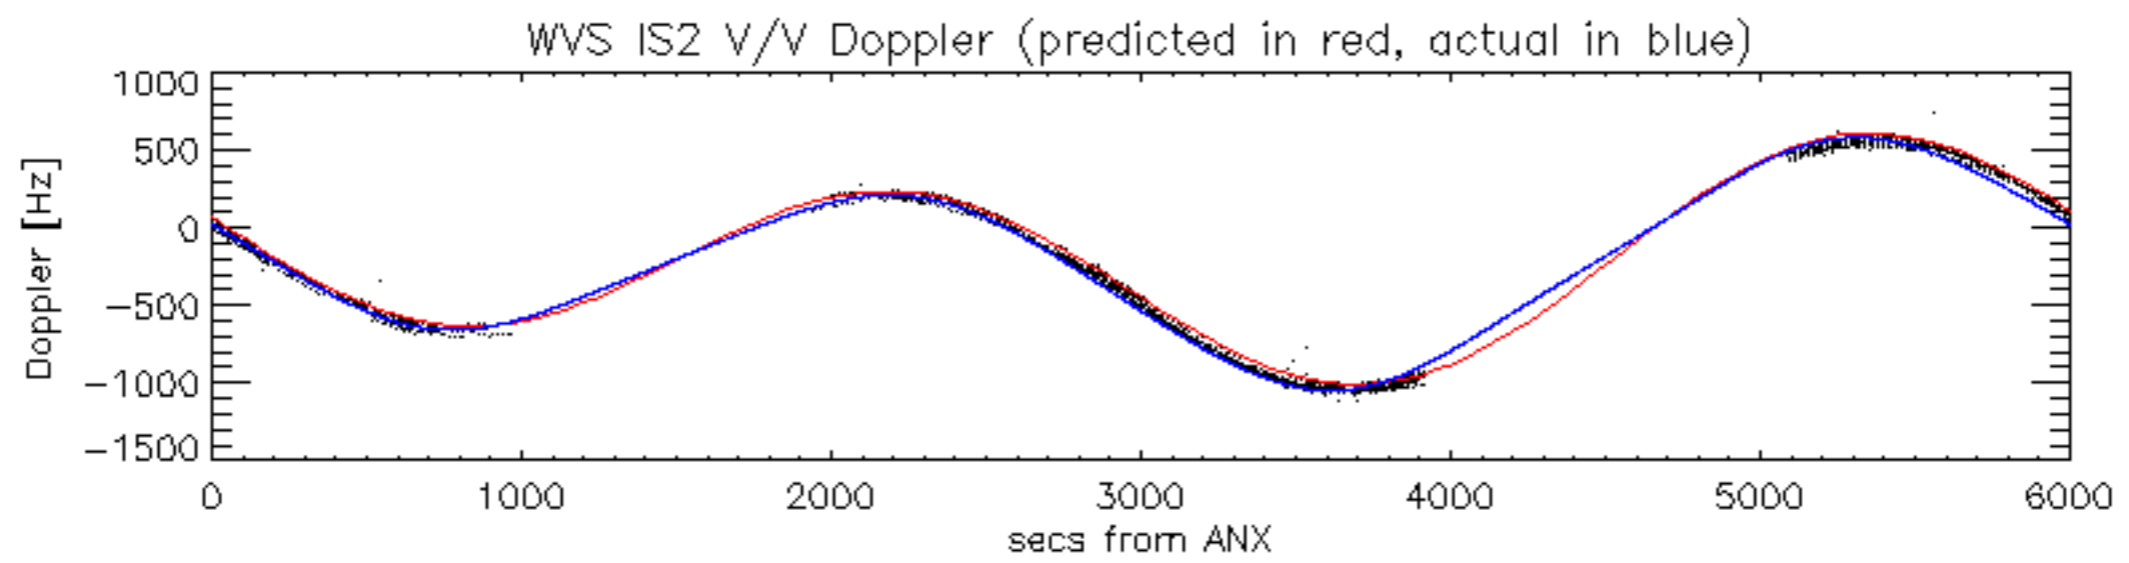





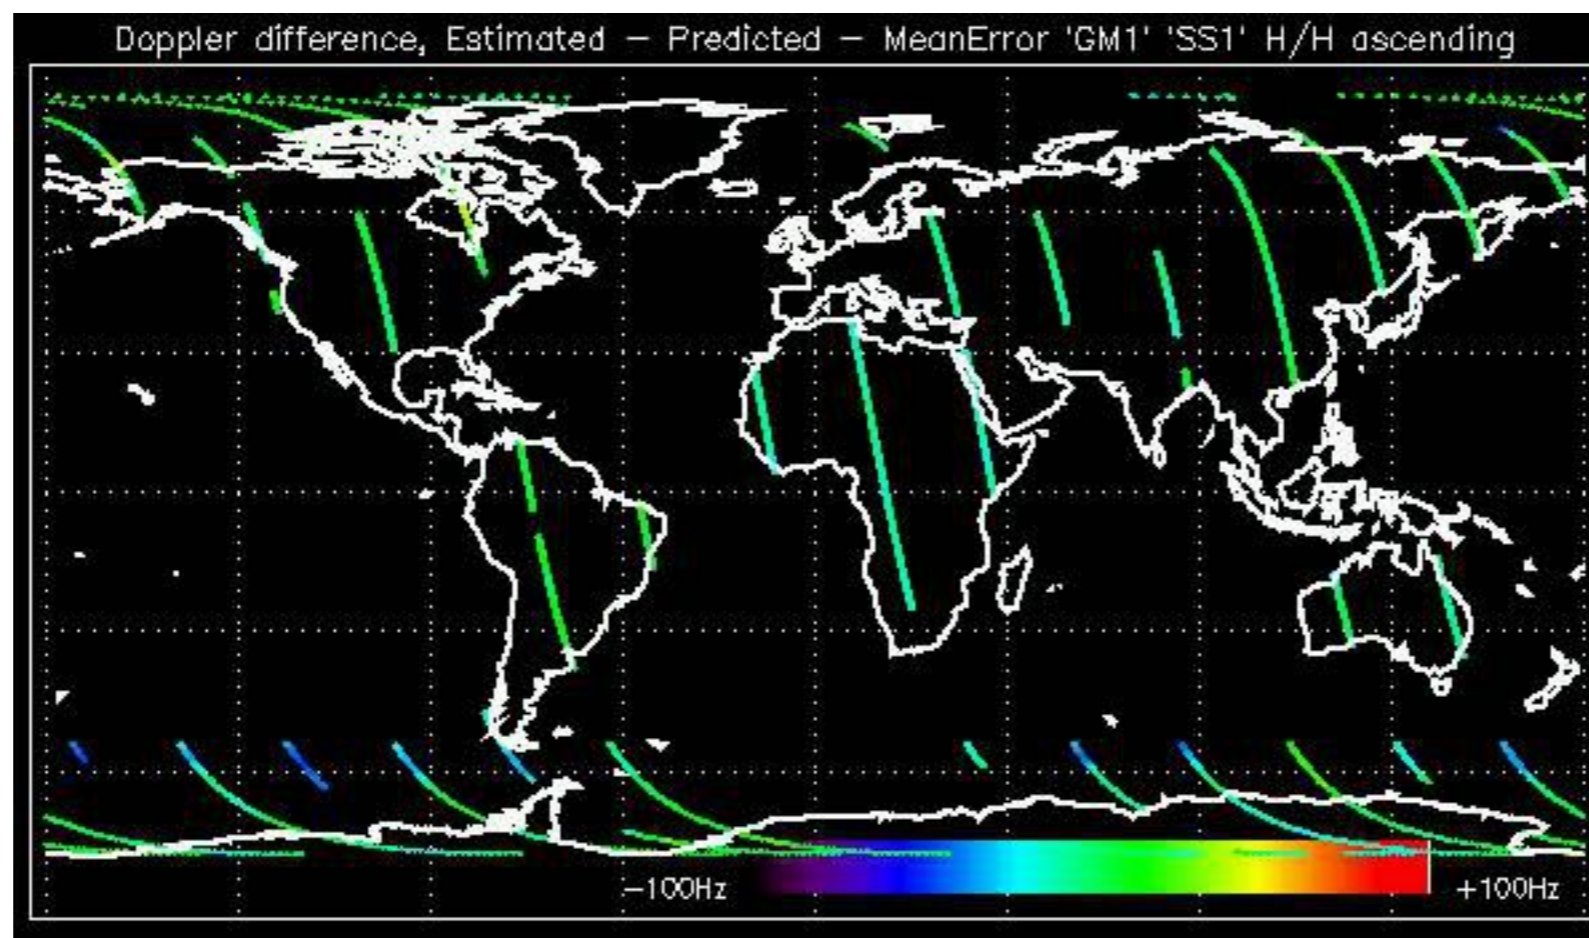


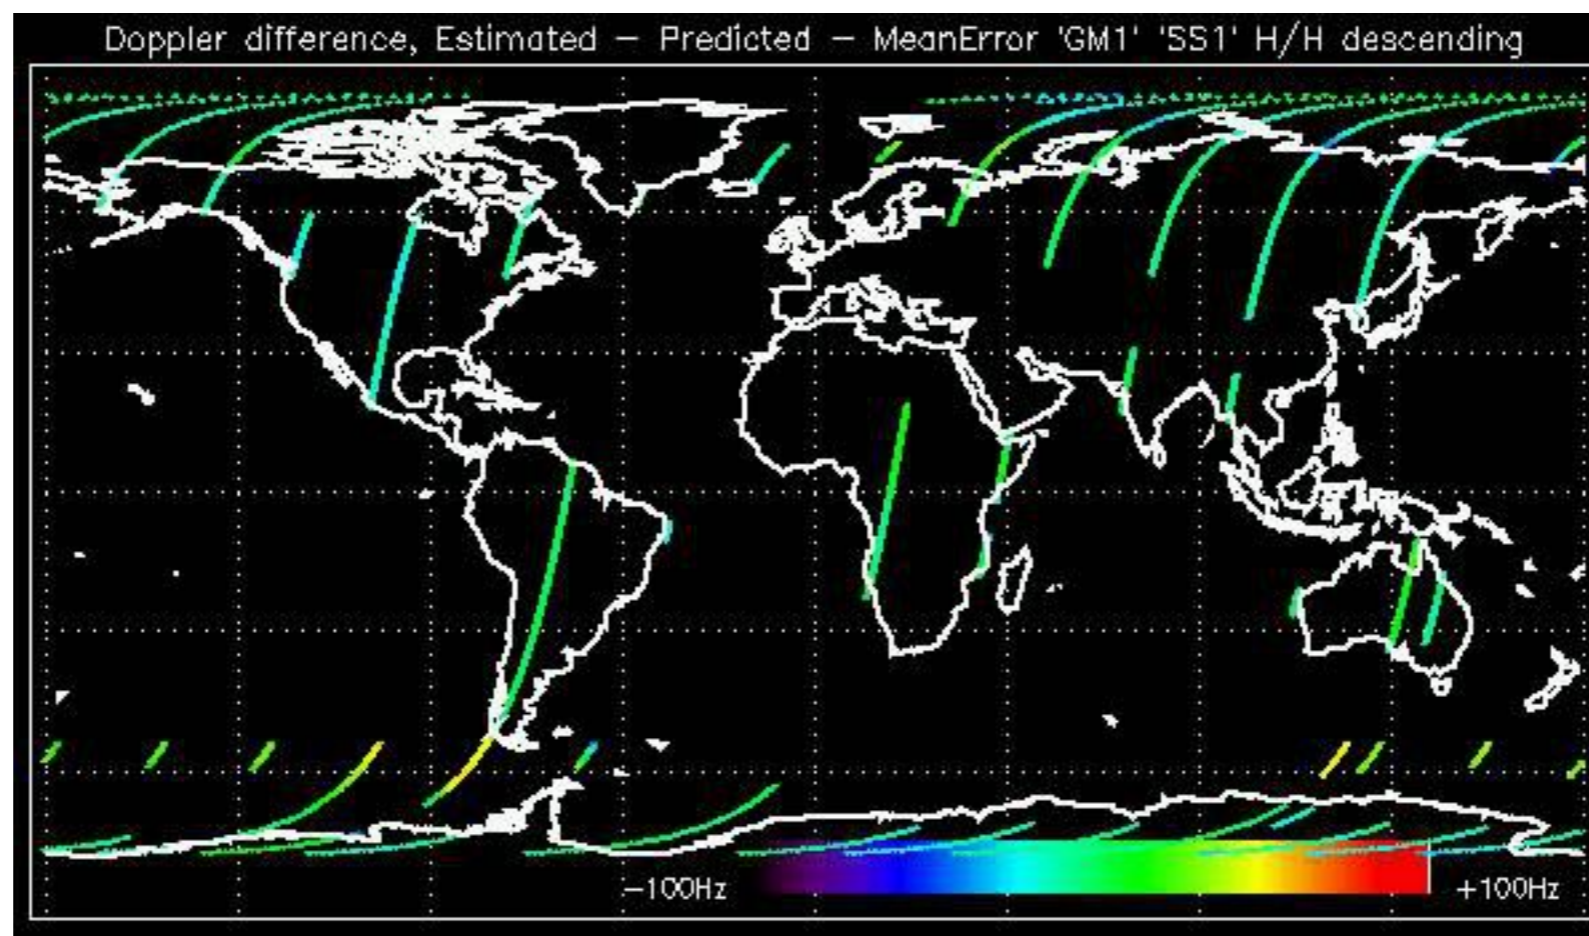


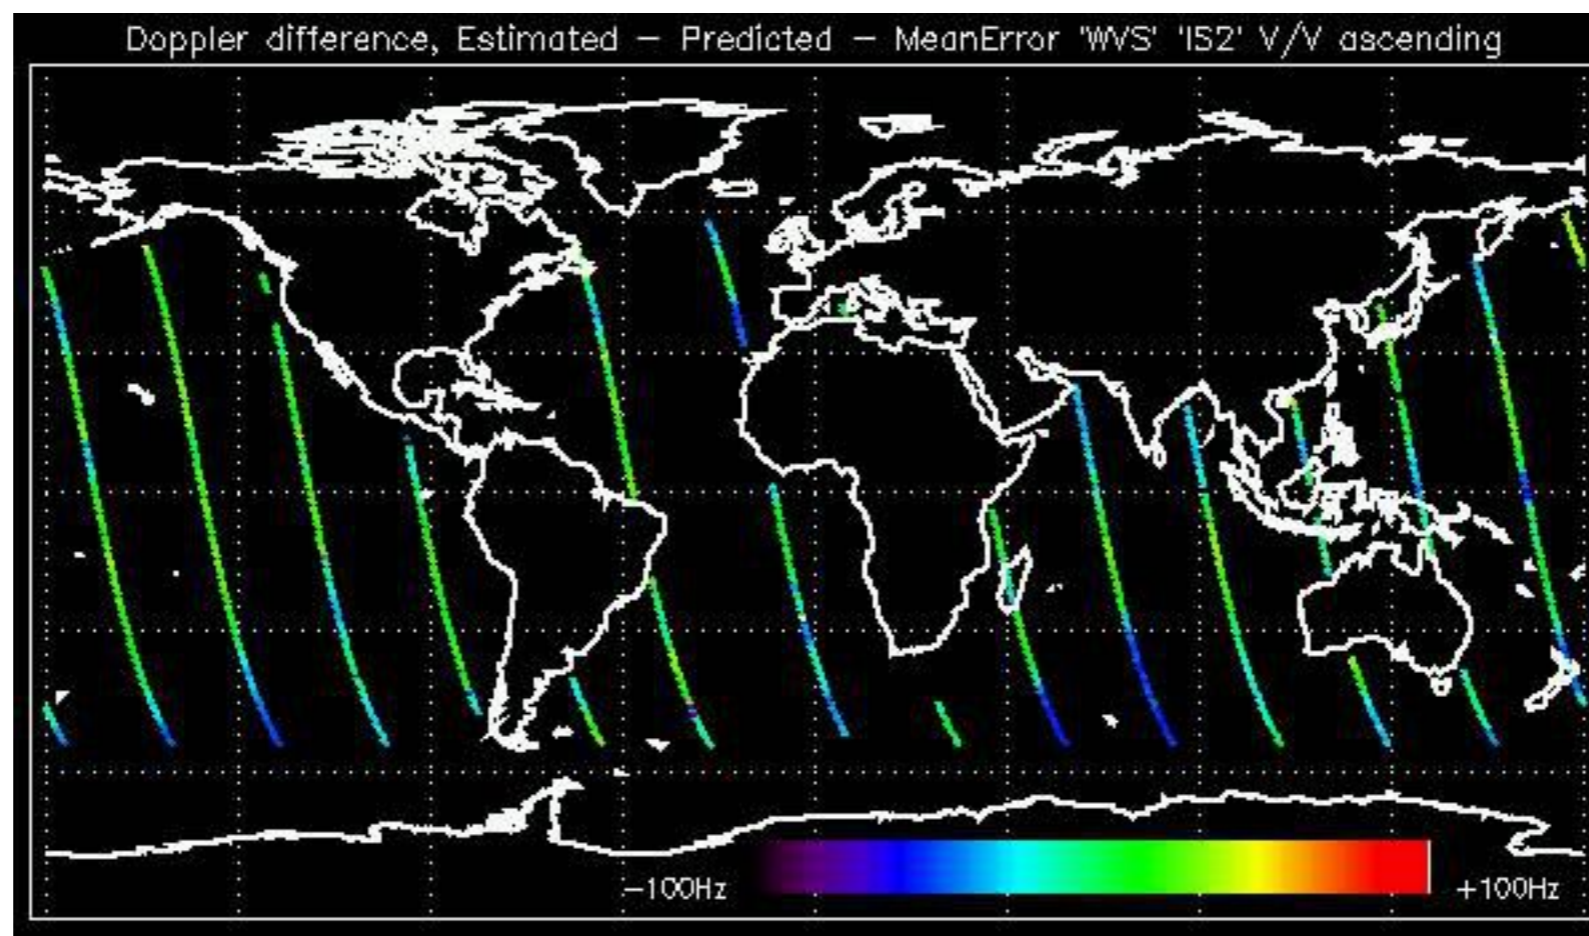


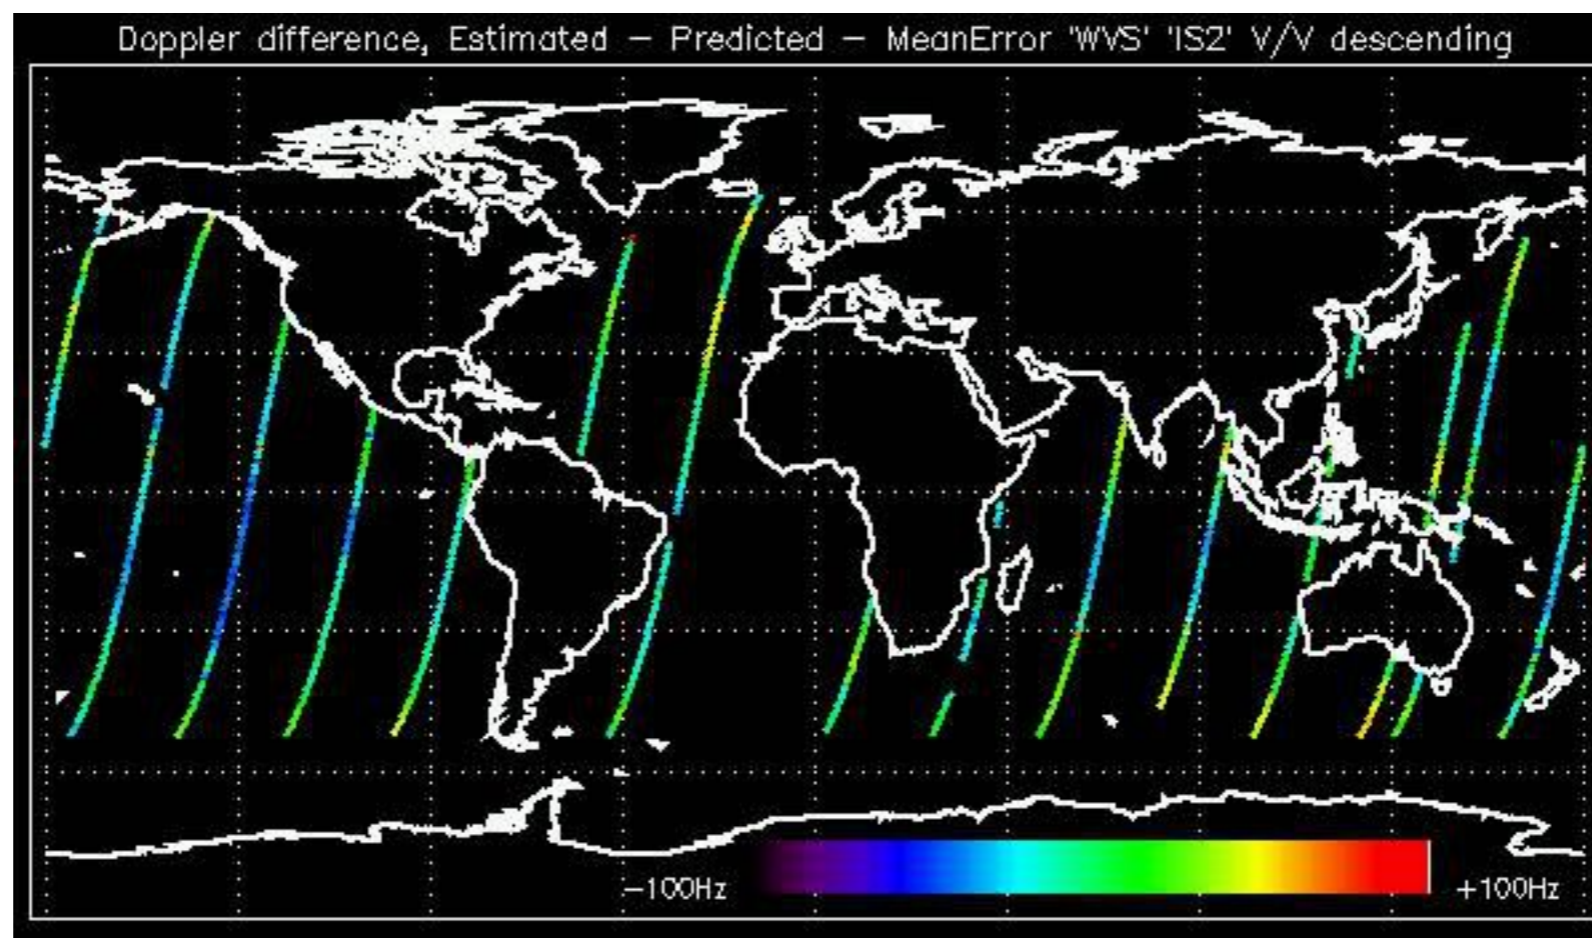

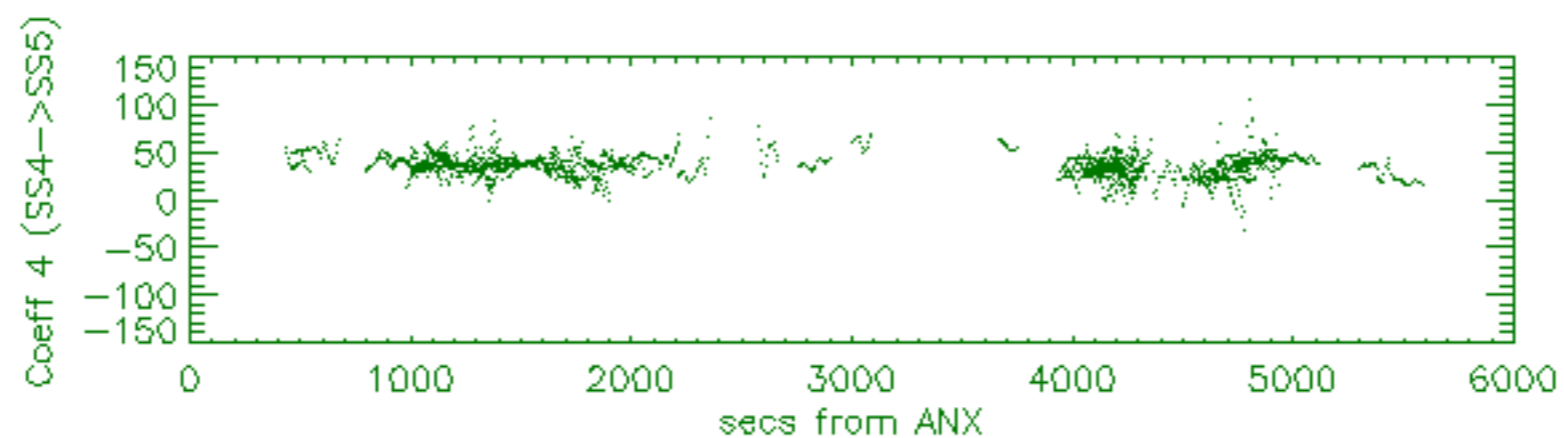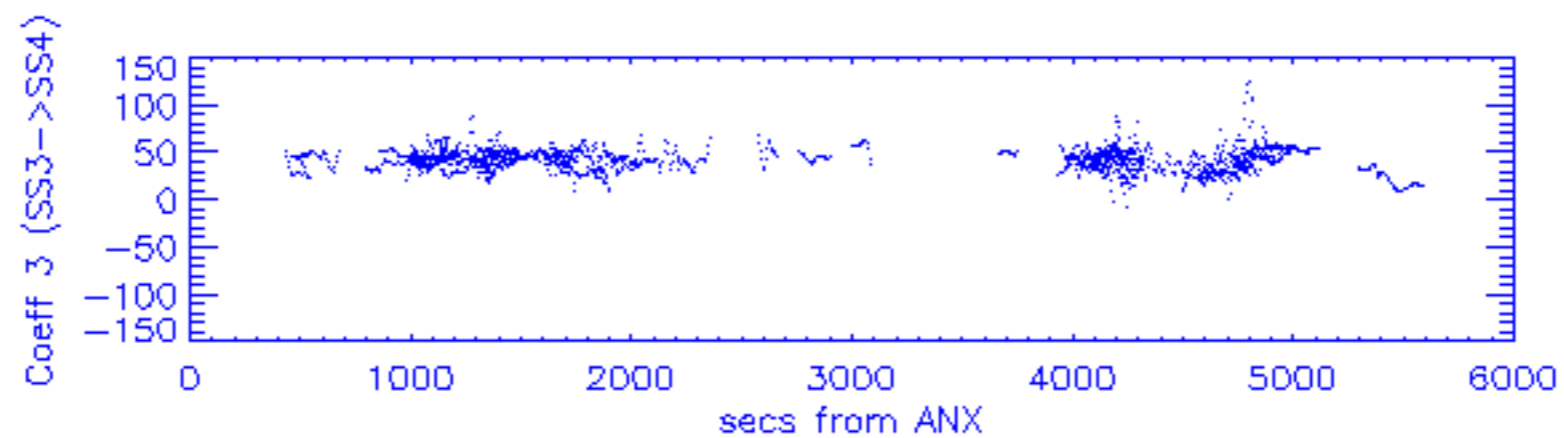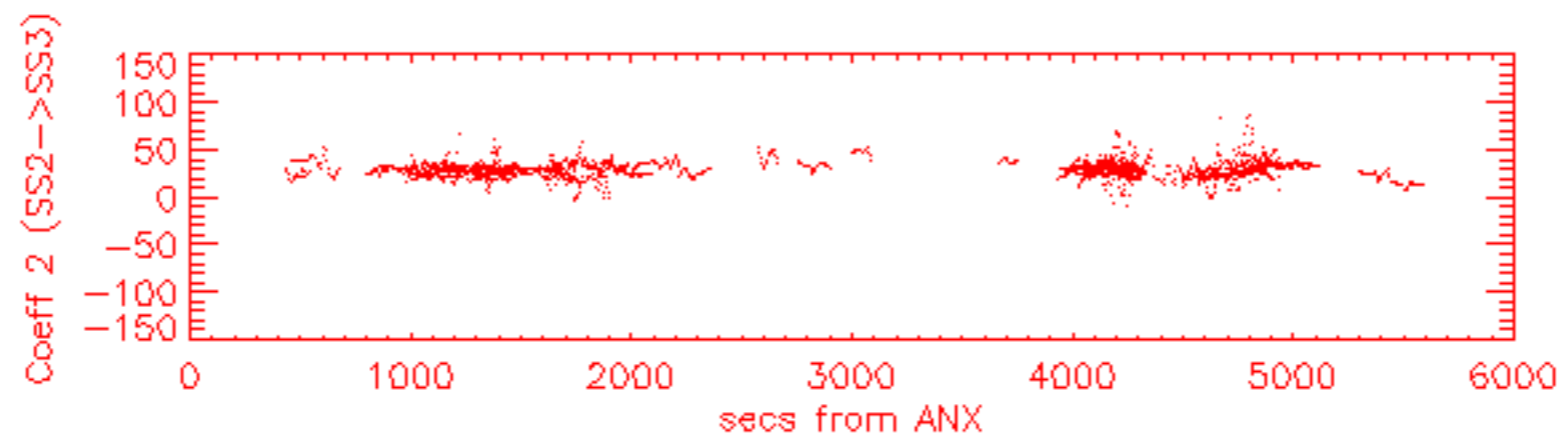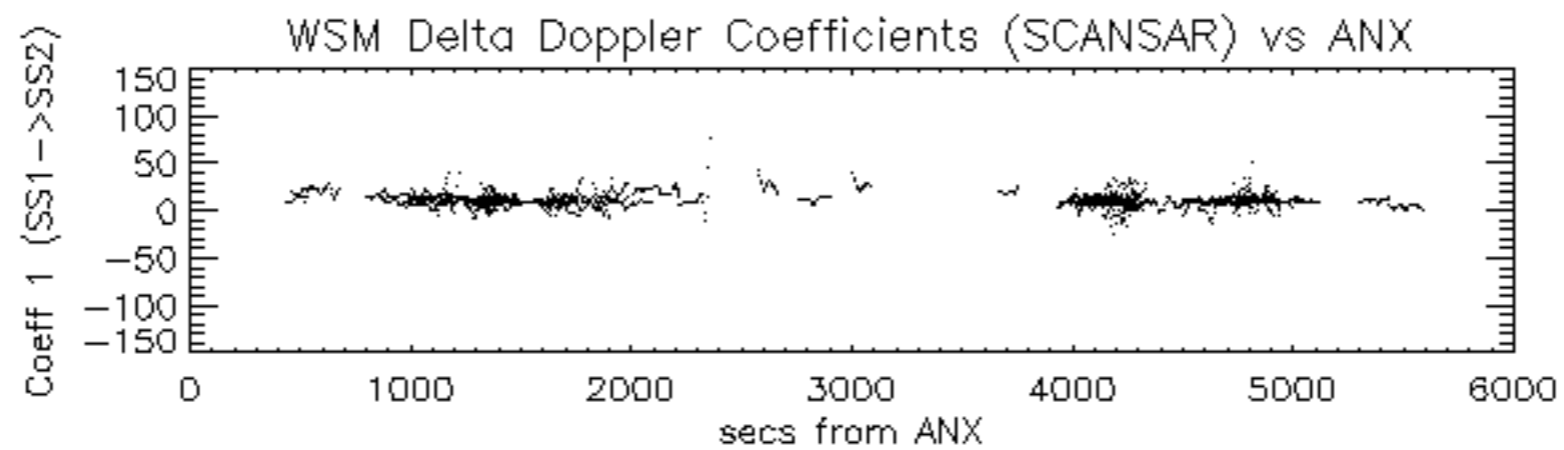


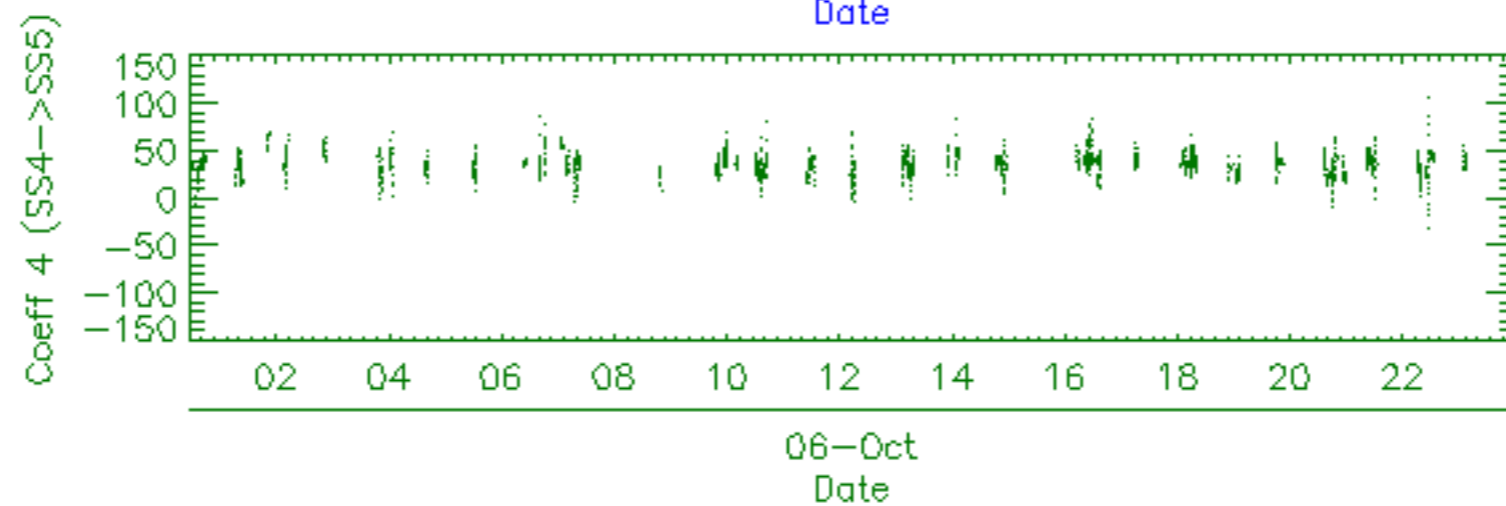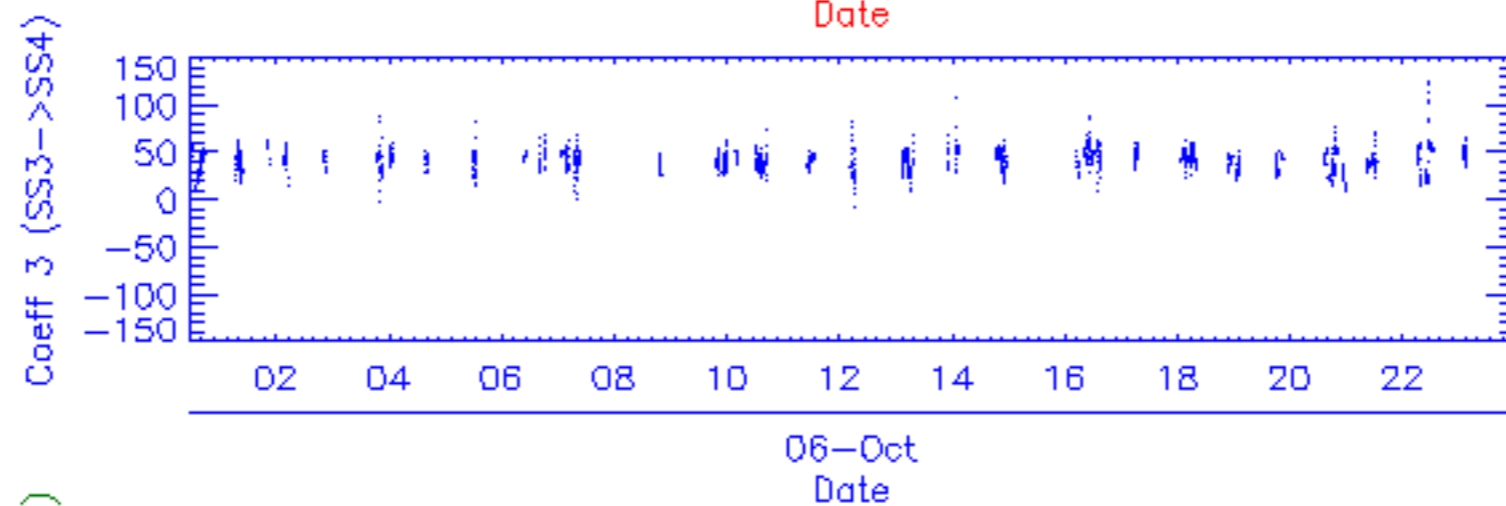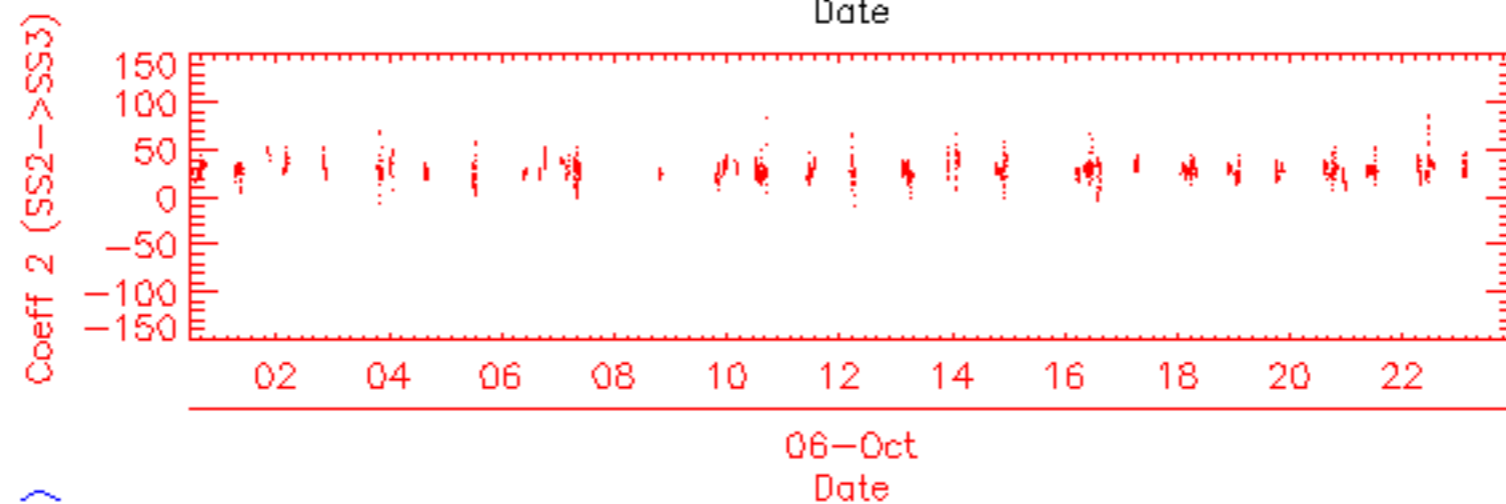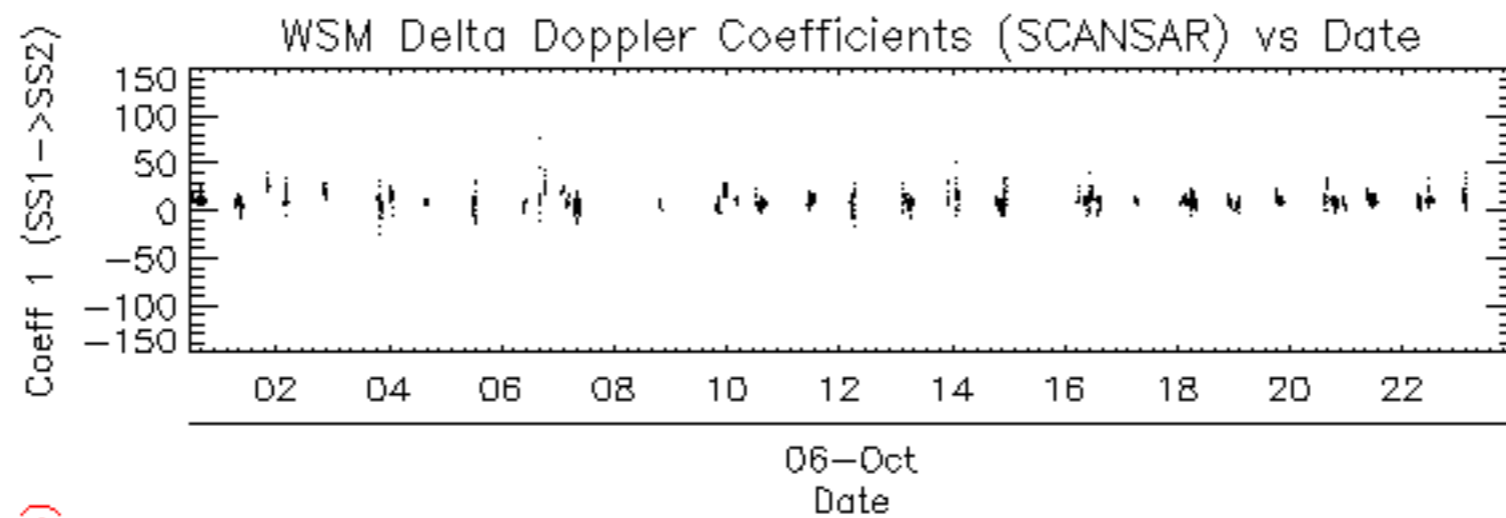

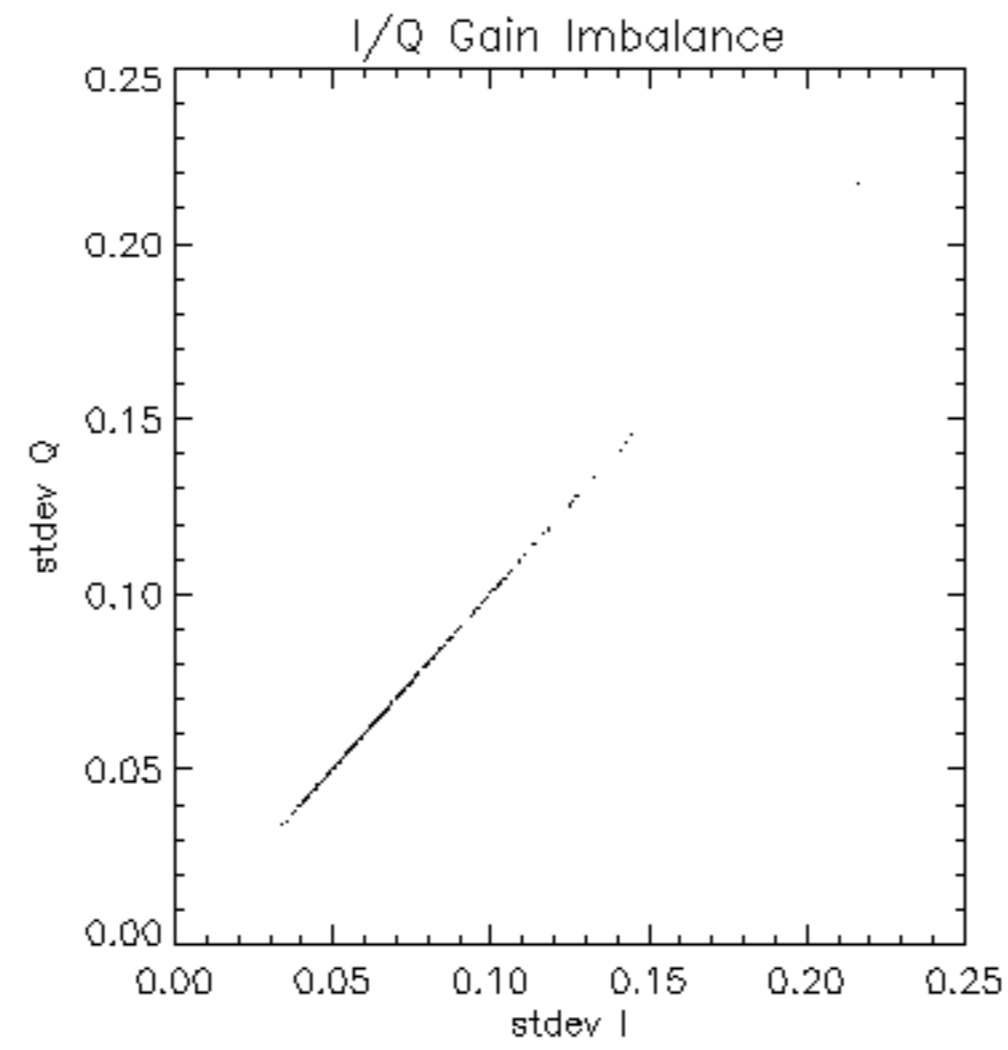


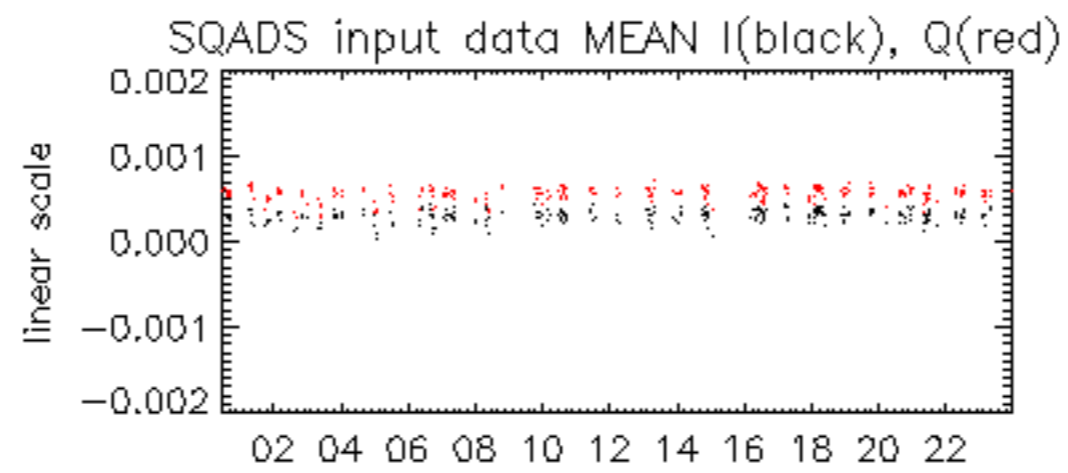




06-Oct

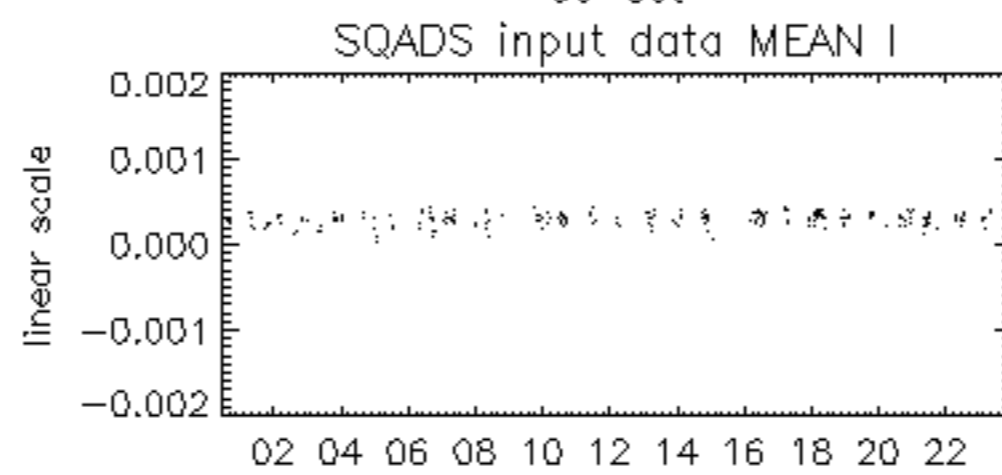



06-Oct

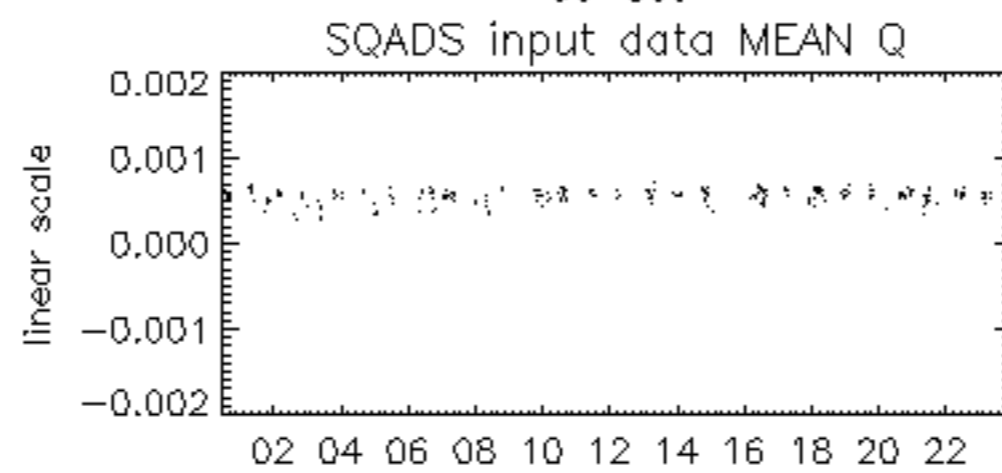


06-Oct

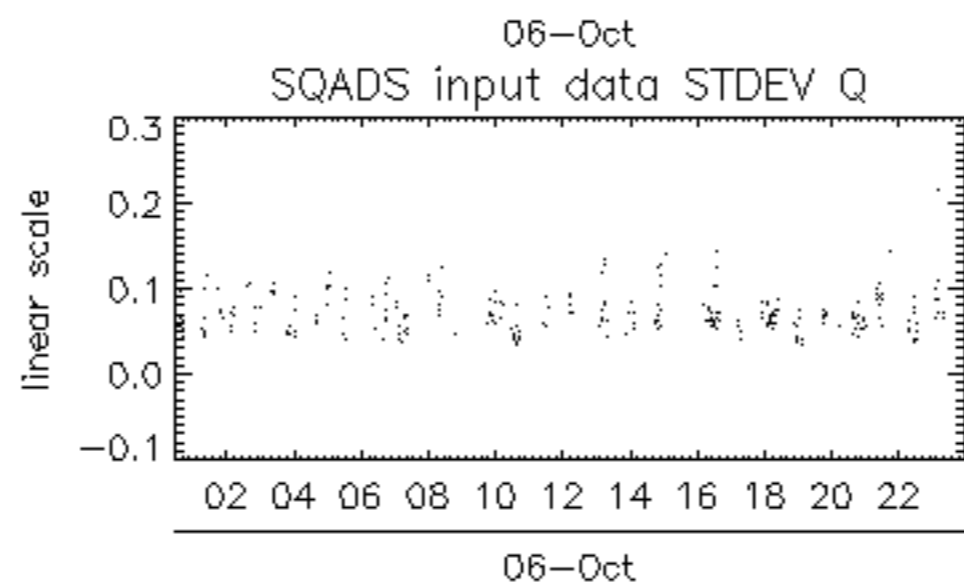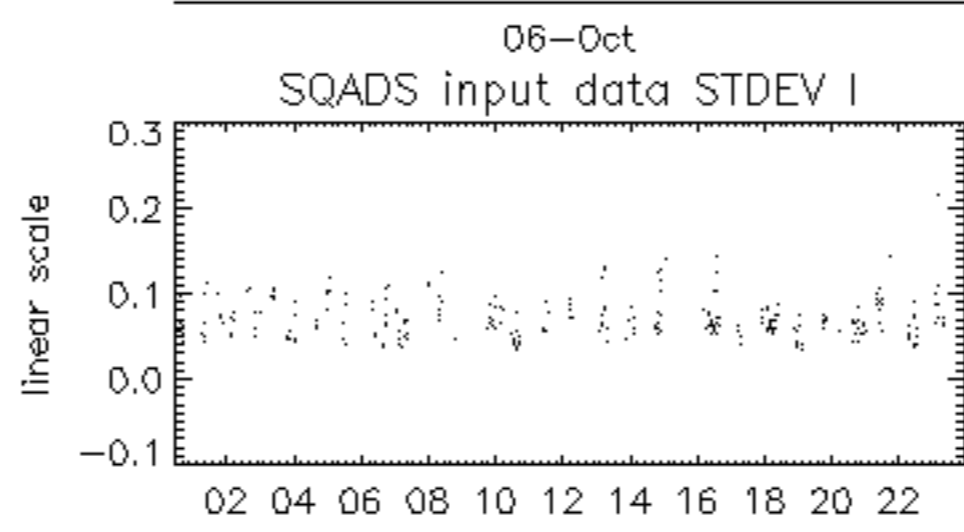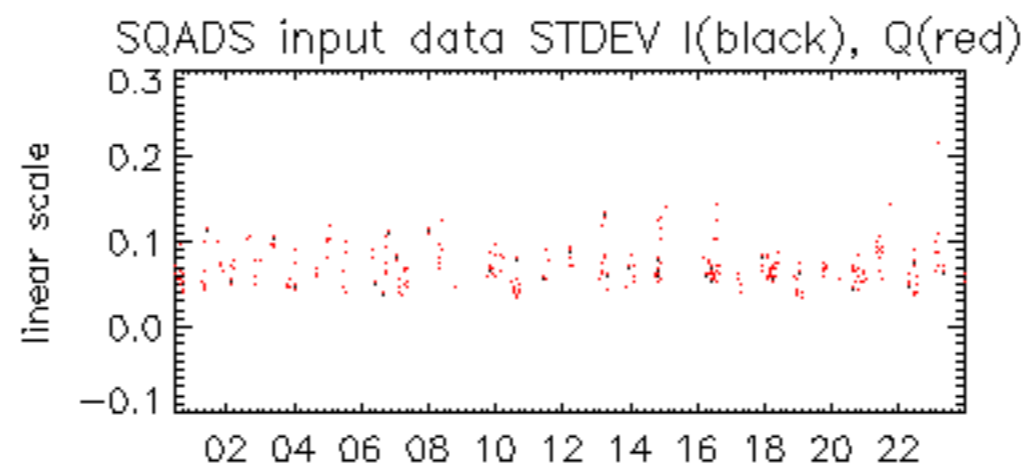

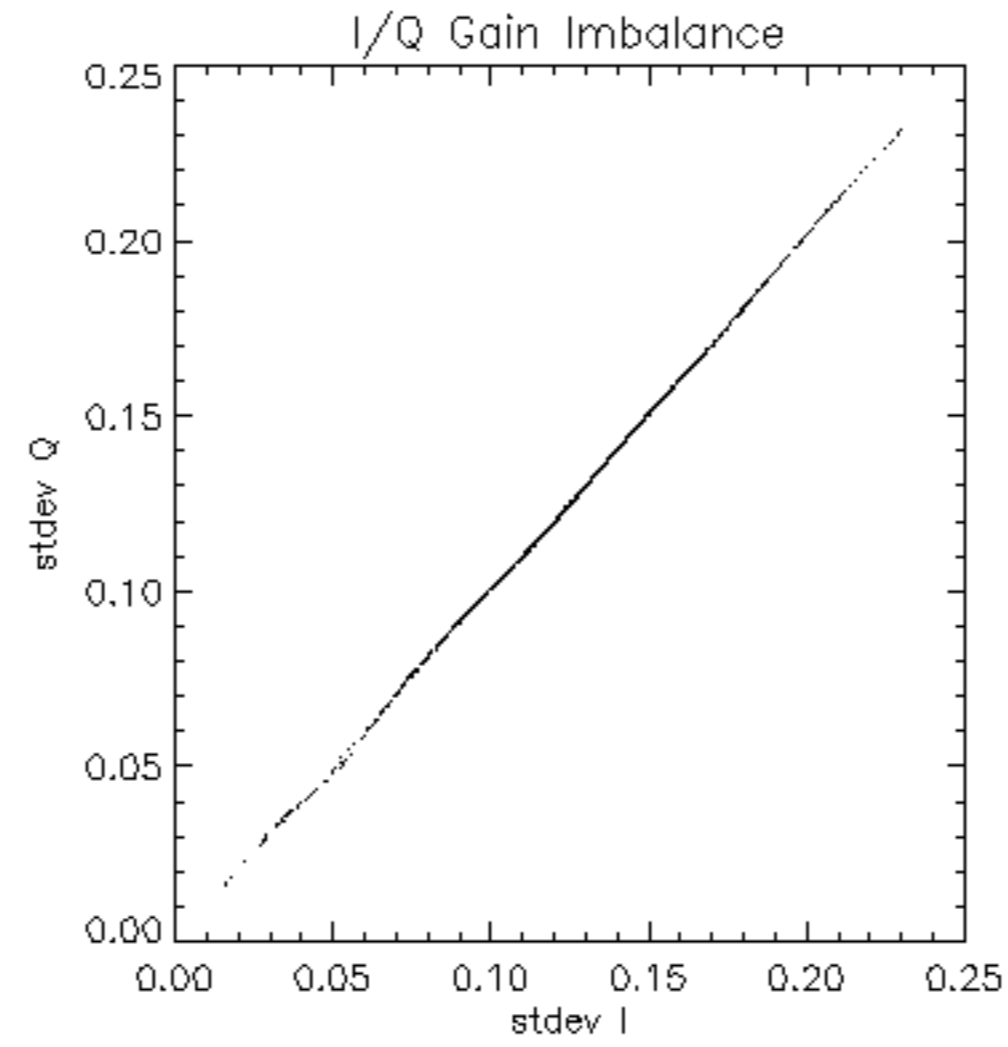


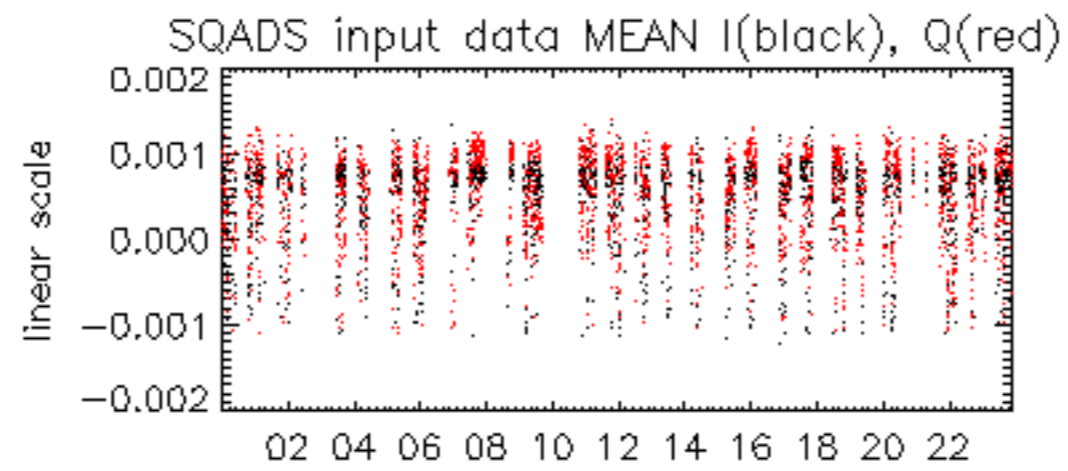


06-Oct

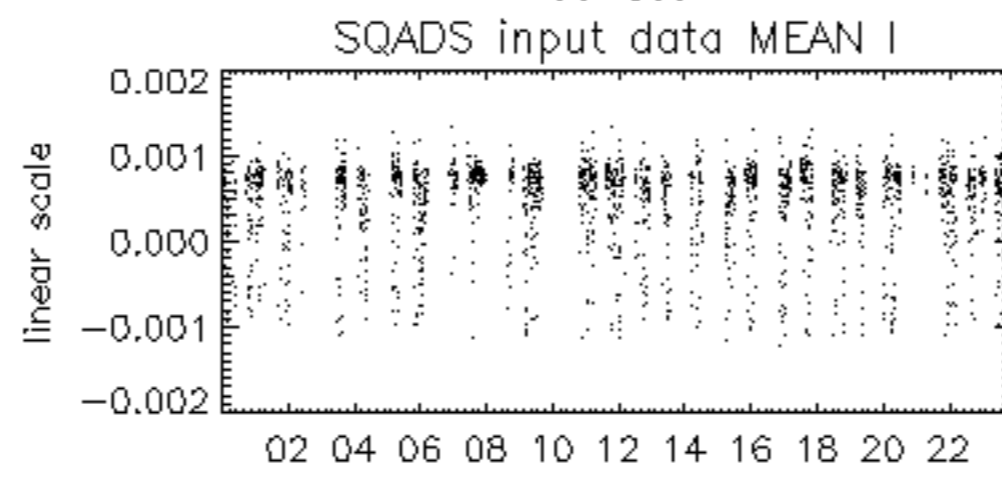


06-Oct

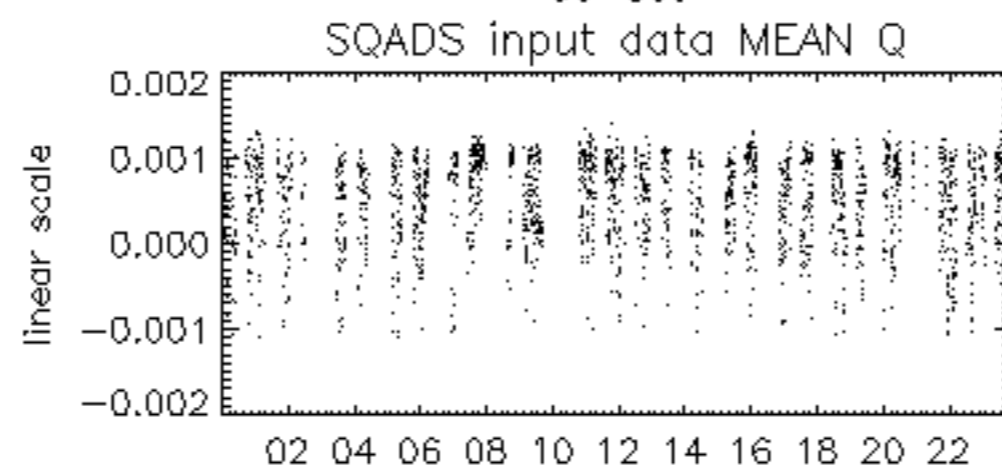


06-Oct

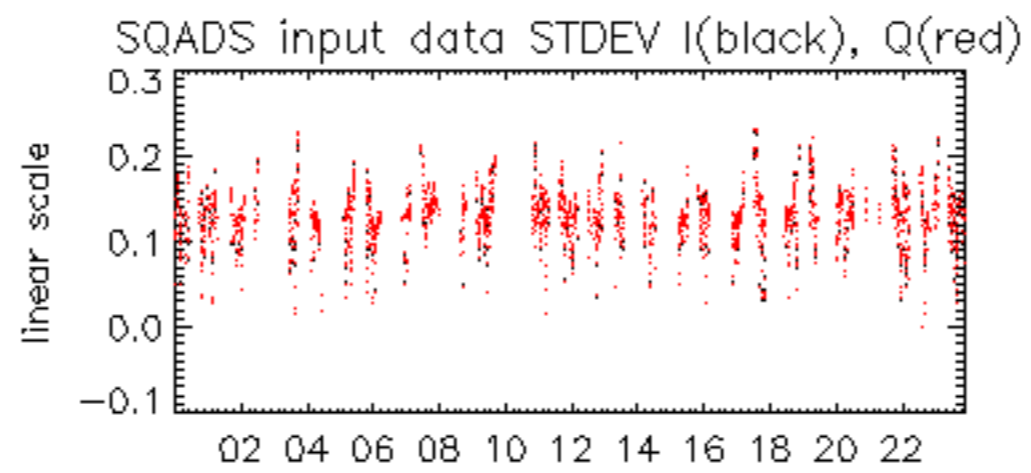

06-Oct

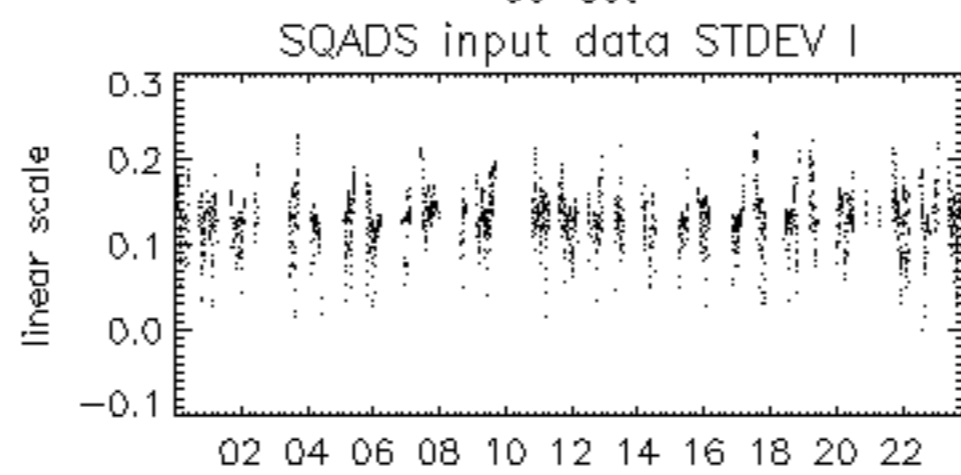

06-Oct

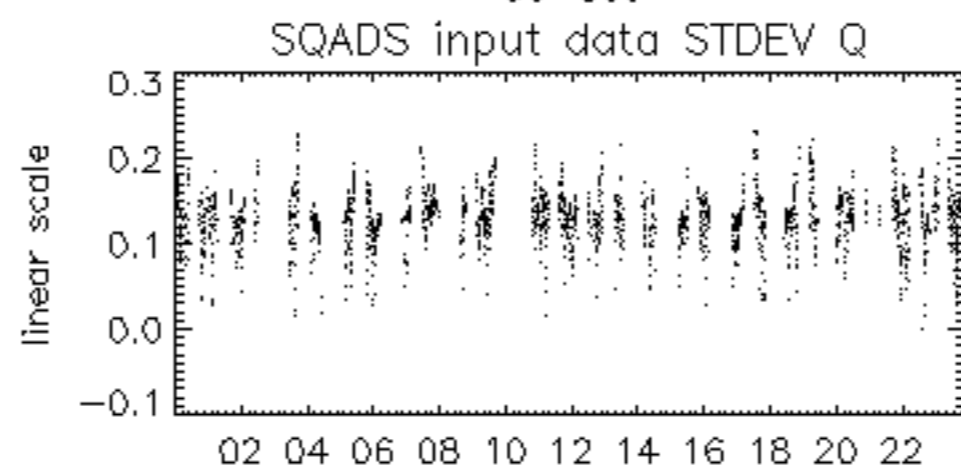

06-Oct

