



Analysis from 23-NOV-2009 00:00:00 to 23-NOV-2009 23:59:59. Page generated on 26-NOV-2009 14:44:24.  
View log file: ASAR\_Daily\_Report\_20091126\_1442.log. For any anomalies please contact emma.griffiths@vega.co.uk, kajal.haria@vega.co.uk.

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

## SUMMARY

1. DATA SUMMARY
  - 1.1 Summary tables
  - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
  - 2.1 IECF operational ADFs list
  - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
  - 3.1 V/V polarisation
  - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
  - 4.1 Analysis for WVS IS2 V/V
    - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
    - 4.1.2 All Rows Analysis for WVS IS2 V/V
  - 4.2 Analysis for GM1 SS3 H/H
    - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
    - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
  - 5.1 Analysis for WVS IS2 V/V
    - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
    - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
  - 5.2 Analysis for GM1 SS1 H/H
    - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
    - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
  - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
  - 6.1 Analysis for WSM SS1 H/H
    - 6.1.1 ScaleFactor
  - 6.2 Analysis for WSM SS1 V/V
    - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
  - 7.1 Analysis for WVS
  - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
  - 8.1 Number of Missing Lines
  - 8.2 Number of Gaps

---

## 1 - DATA SUMMARY

### 1.1 - Summary tables

[ [BACK TO MENU](#) ]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	4	PDE	WS	H/H	35	PDE	IS2	V/H	1	PDE	IS2	***	1	PDE	WS	H/H	84	PDE	2009-11-23 01:59:15	H	320
PDE	IS2	V/V	26	PDK	WS	H/H	39					PDE	IS2	H/H	29	PDE	WS	V/V	6	PDK	2009-11-23 08:41:39	V	320
PDK	IS2	V/V	21									PDE	IS2	V/V	24	PDK	WS	H/H	16				
												PDK	IS2	H/H	2	PDK	WS	V/V	2				
												PDK	IS2	V/V	1								
												PDK	IS7	V/V	1								

## 1.2 - Lists of products used

[ [BACK TO MENU](#) ]

[TXT] [XLS] [List\\_WVS\\_products\\_used](#)  
 [TXT] [XLS] [List\\_GM1\\_products\\_used](#)  
 [TXT] [XLS] [List\\_APM\\_products\\_used](#)  
 [TXT] [XLS] [List\\_IMM\\_products\\_used](#)  
 [TXT] [XLS] [List\\_WSM\\_products\\_used](#)  
 [TXT] [XLS] [List\\_MS\\_products\\_used](#)

## 2 - AUXILIARY FILES ANALYSIS

### 2.1 - IECF operational ADFs list

[ [BACK TO MENU](#) ]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20081215_141339_20070204_165113_20091231_000000
ASA_INS_AXVIEC20090525_114808_20090428_100000_20091231_235959
ASA_XCH_AXVIEC20081215_143642_20020301_000000_20091231_000000
ASA_XCA_AXVIEC20090311_104501_20080801_000000_20091231_235959

### 2.2 - Products with wrong ADFs





[ [BACK TO MENU](#) ]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0

[TXT] [XLS] [Check\\_ADFs\\_WVS](#)  
 [TXT] [XLS] [Check\\_ADFs\\_GM1](#)  
 [TXT] [XLS] [Check\\_ADFs\\_APM](#)  
 [TXT] [XLS] [Check\\_ADFs\\_IMM](#)  
 [TXT] [XLS] [Check\\_ADFs\\_WSM](#)

### 3 - MODULE STEPPING PRODUCTS ANALYSIS



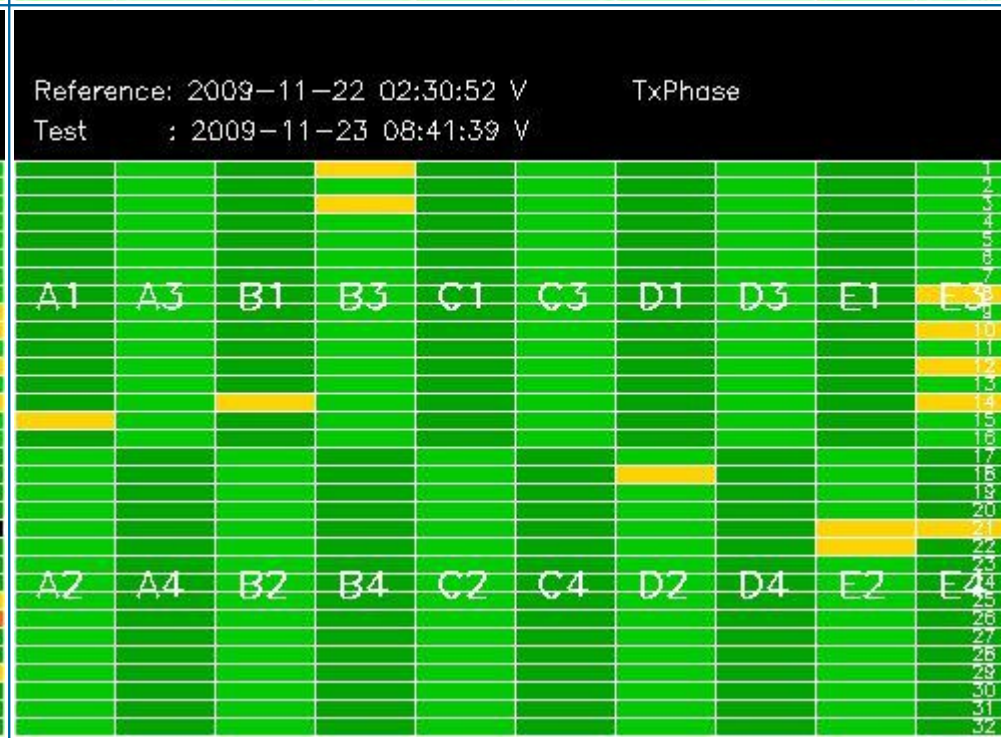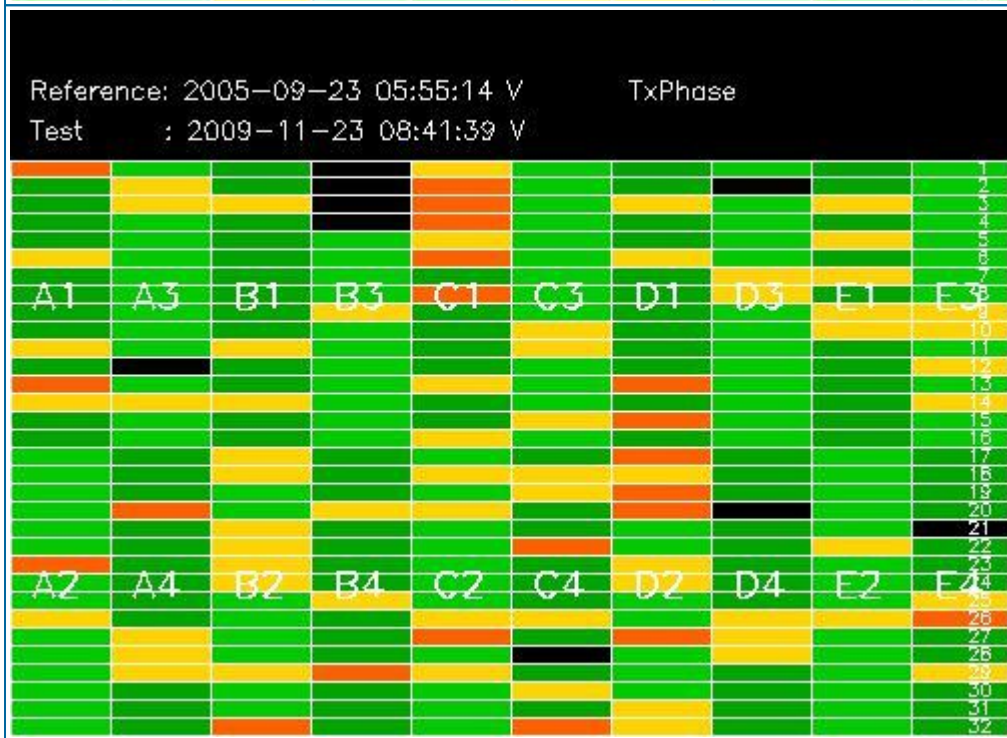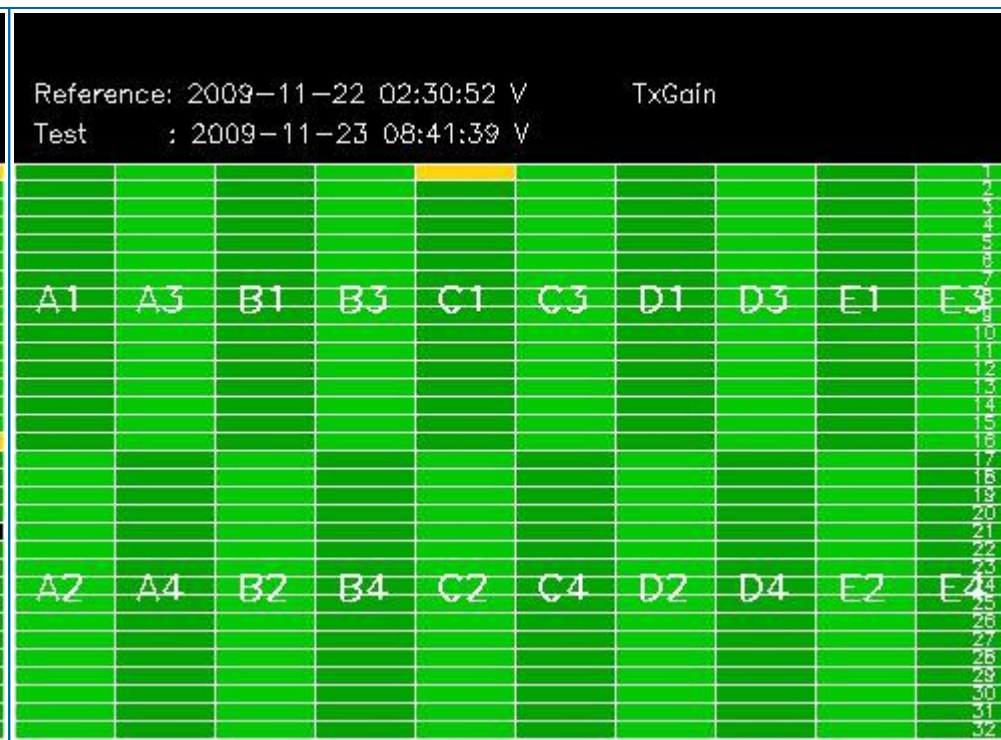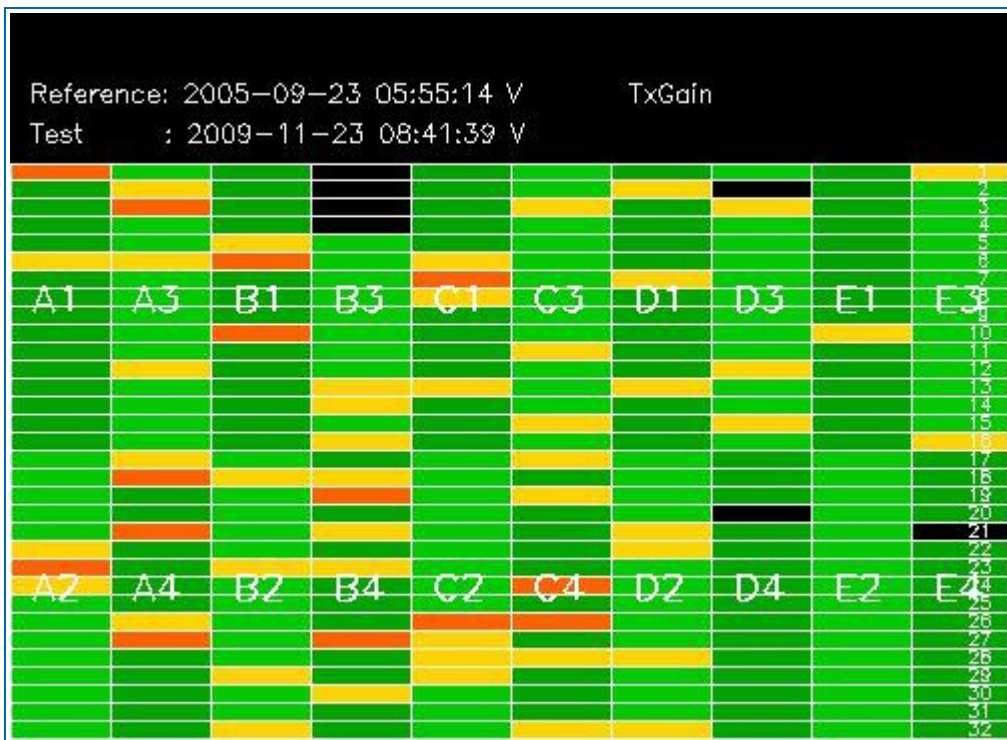

### 3.2 - H/H polarisation


[ [BACK TO MENU](#) ]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
After antenna maintenance (2005-09-22/23)	Previous product in the same polarisation

Reference: 2005-09-22 06:26:51 H RxGain  
 Test : 2009-11-23 01:59:15 H



Reference: 2009-11-21 03:02:29 H RxGain  
 Test : 2009-11-23 01:59:15 H




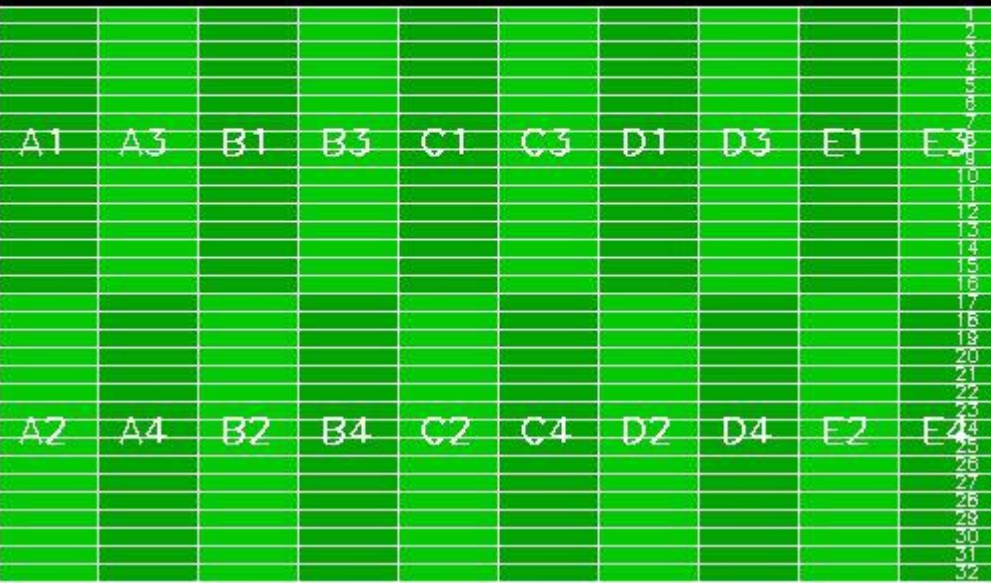


Reference: 2005-09-22 06:26:51 H RxPhase  
 Test : 2009-11-23 01:59:15 H



Reference: 2009-11-21 03:02:29 H RxPhase  
 Test : 2009-11-23 01:59:15 H



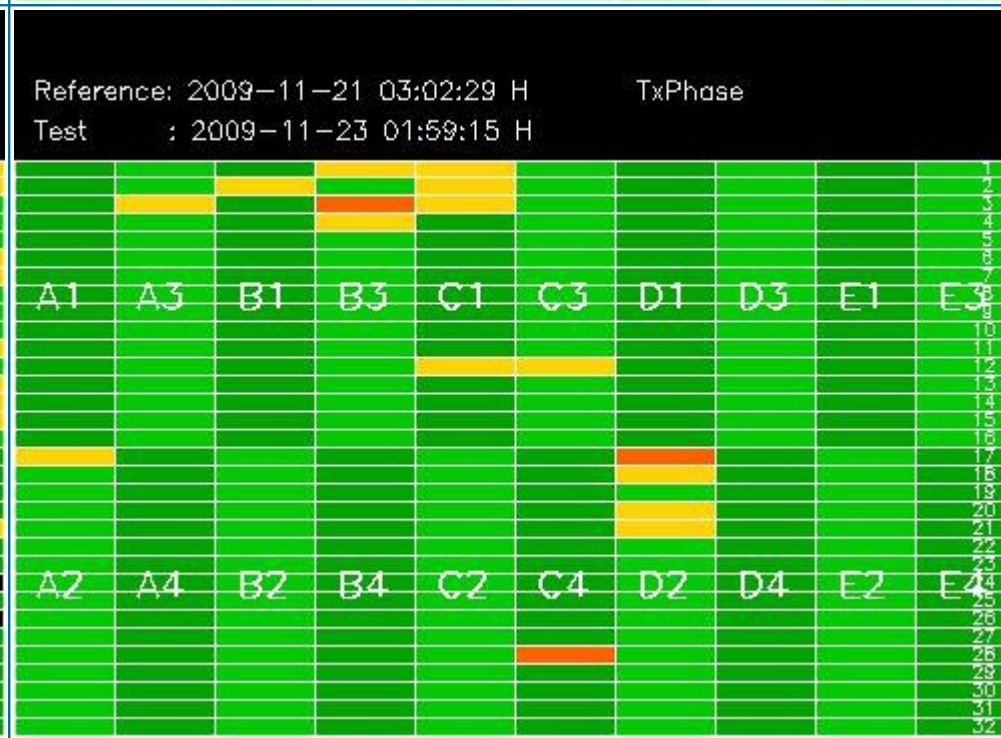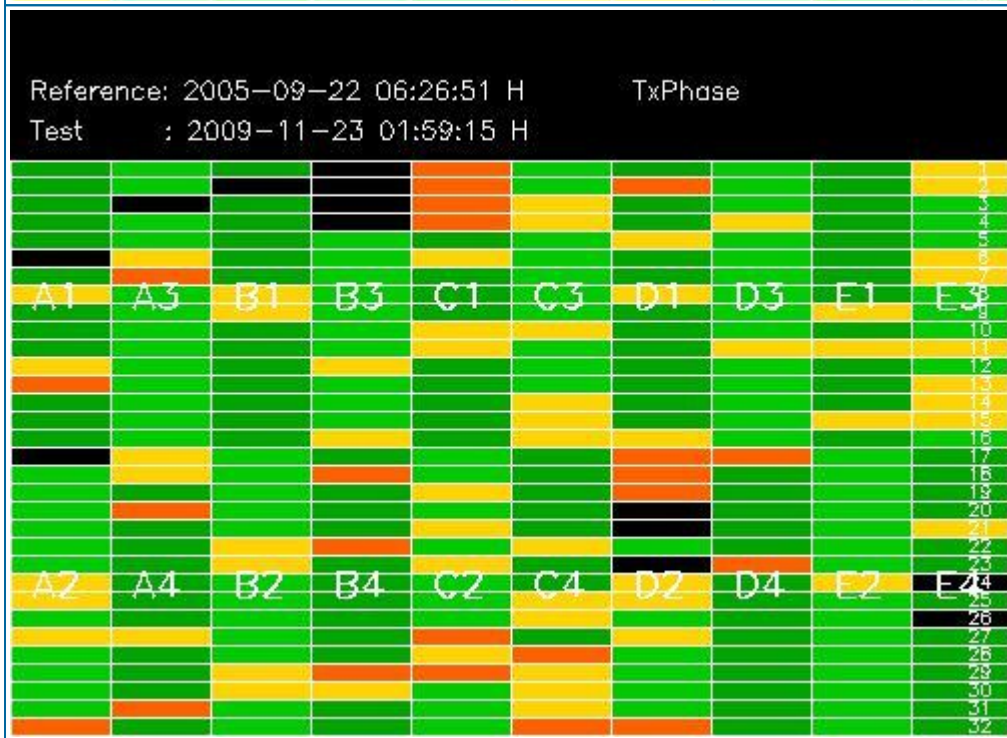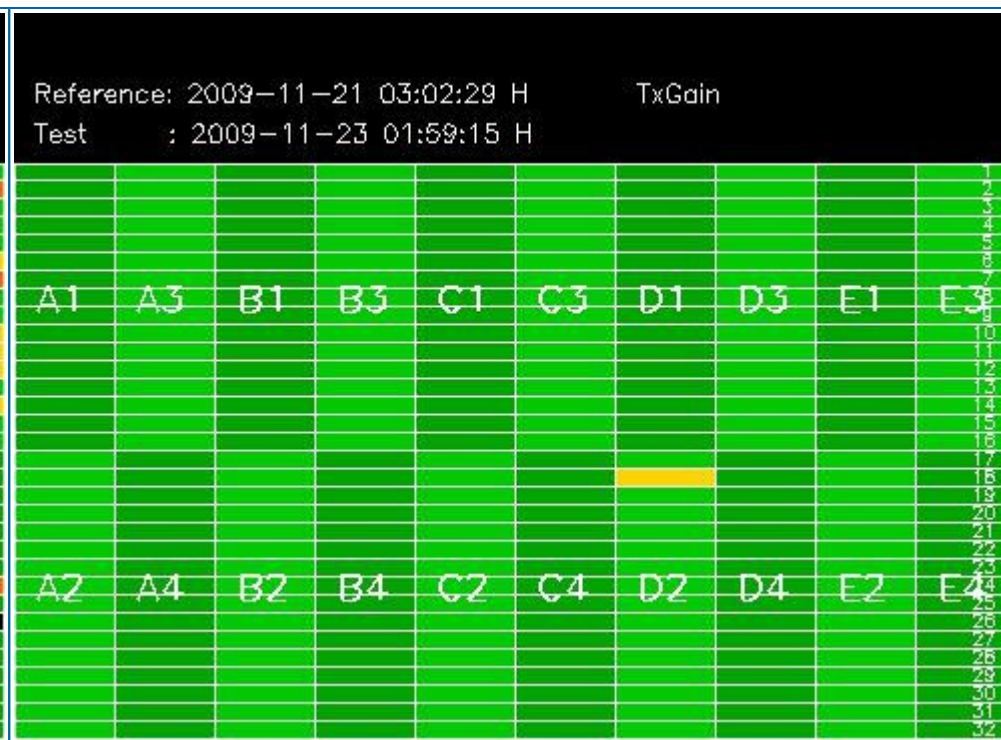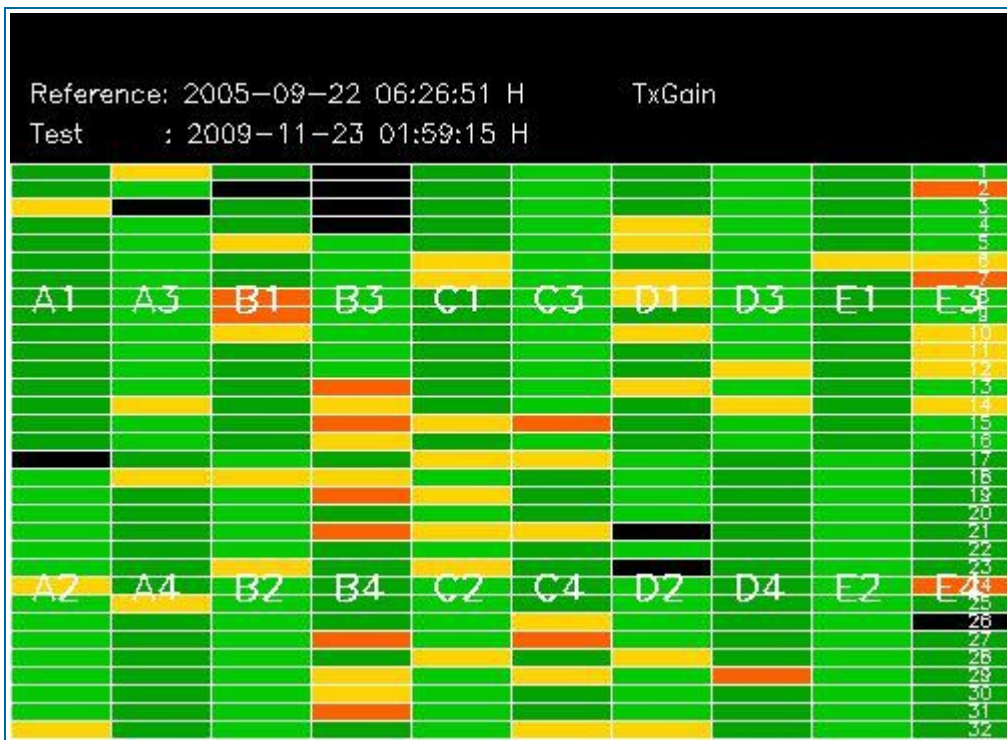

## 4 - CALIBRATION PULSES ANALYSIS

### 4.1 - Analysis for WVS IS2 V/V


#### 4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[ BACK TO MENU ]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for WVS IS2 V/V

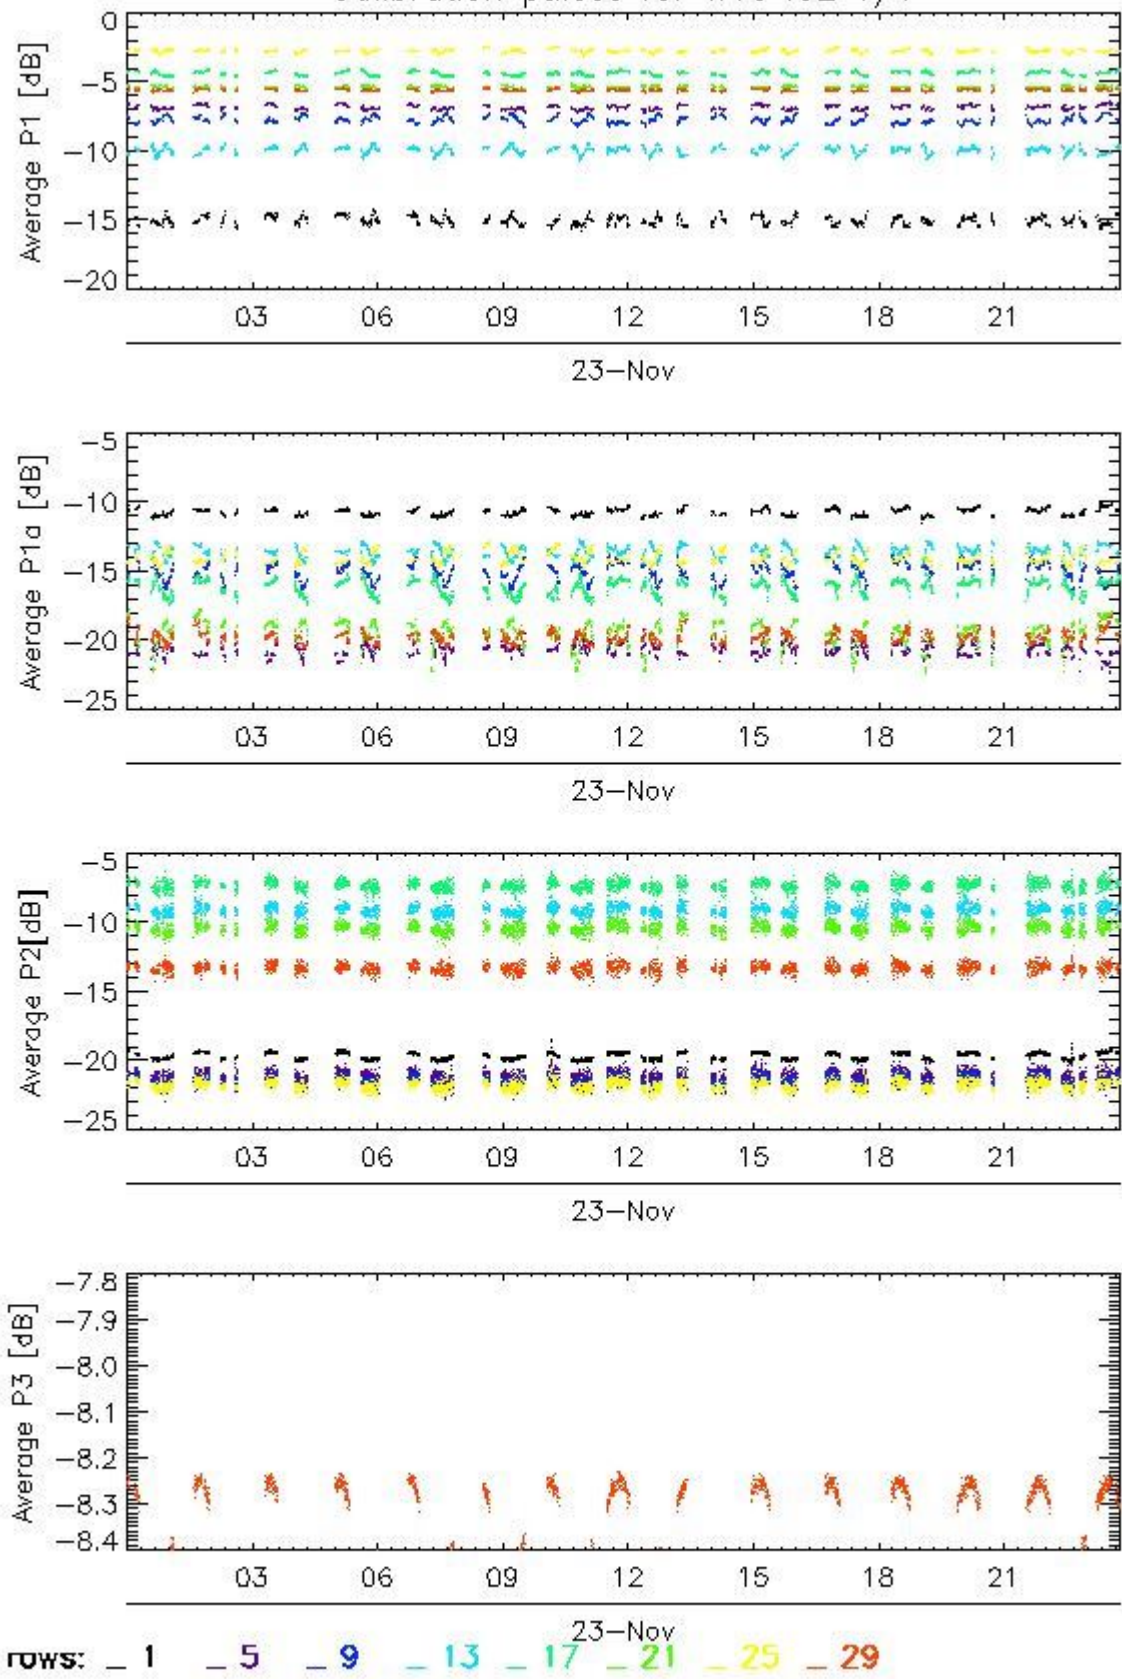


Transmit power (P1 - P1a) for WVS IS2 V/V

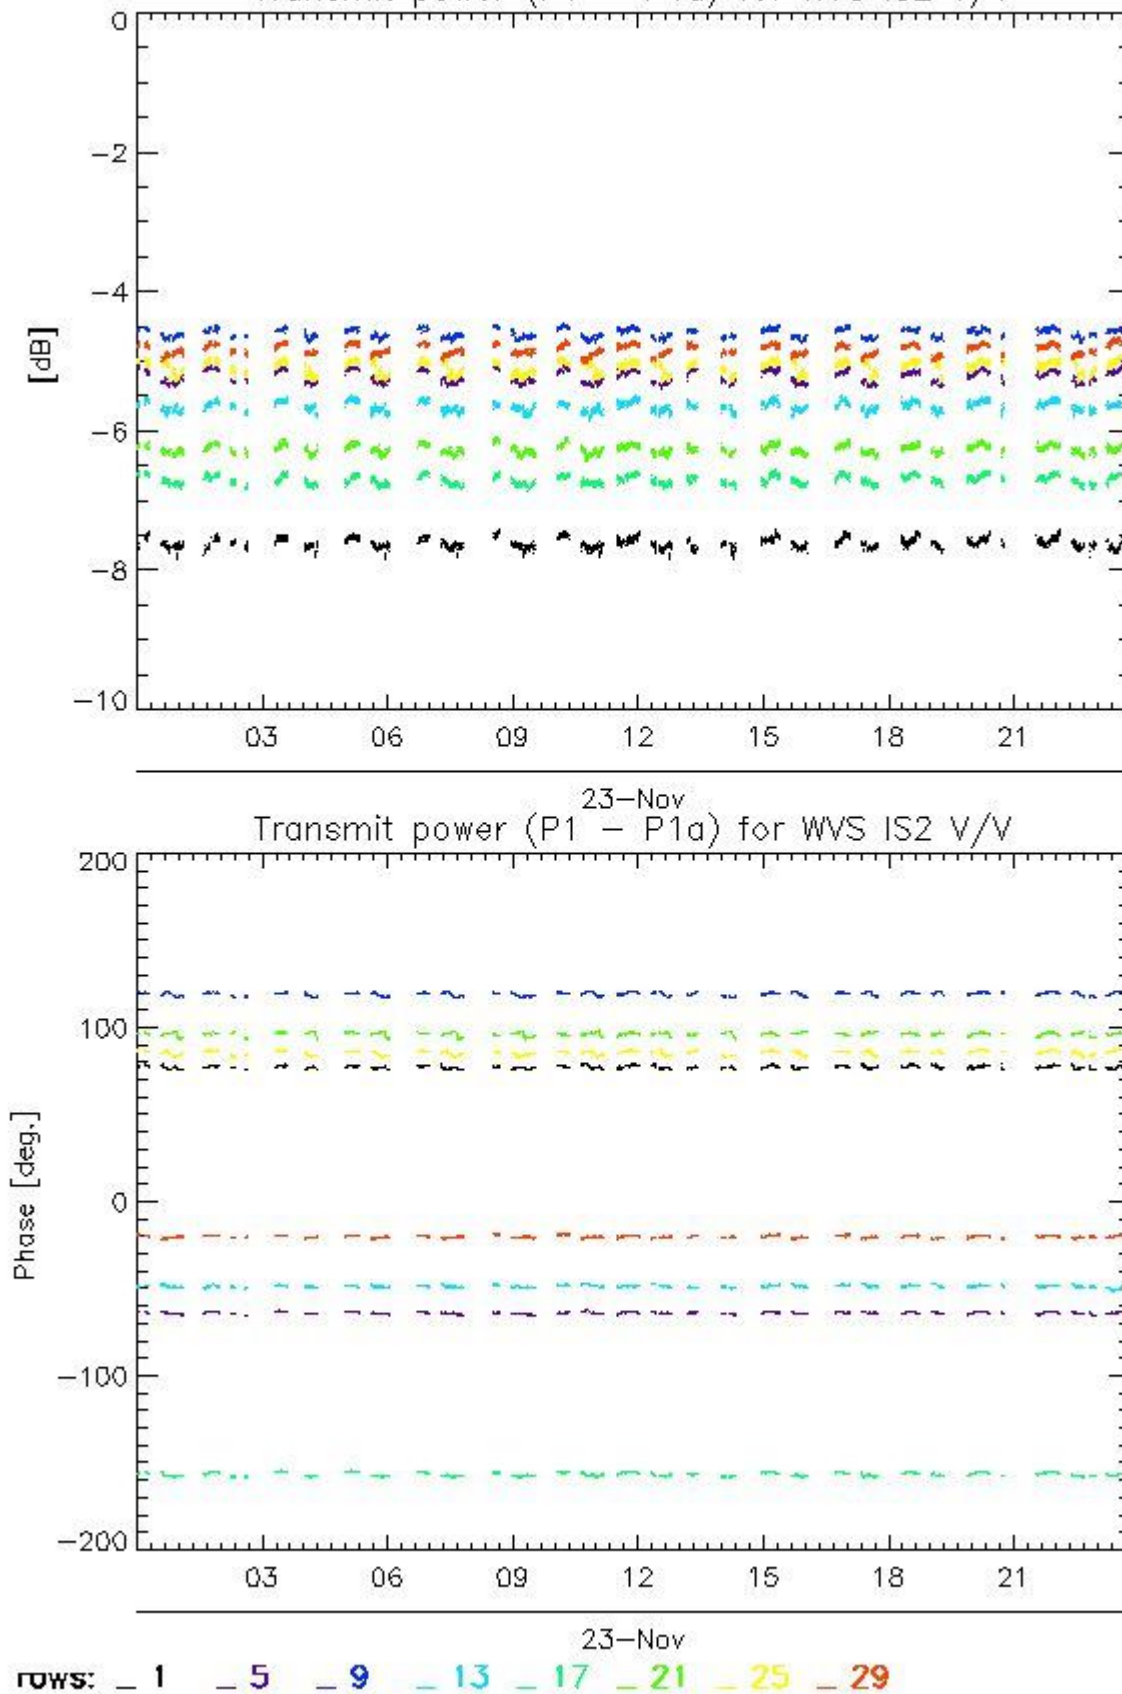

#### 4.1.2 - All Rows Analysis for WVS IS2 V/V

[ BACK TO MENU ]



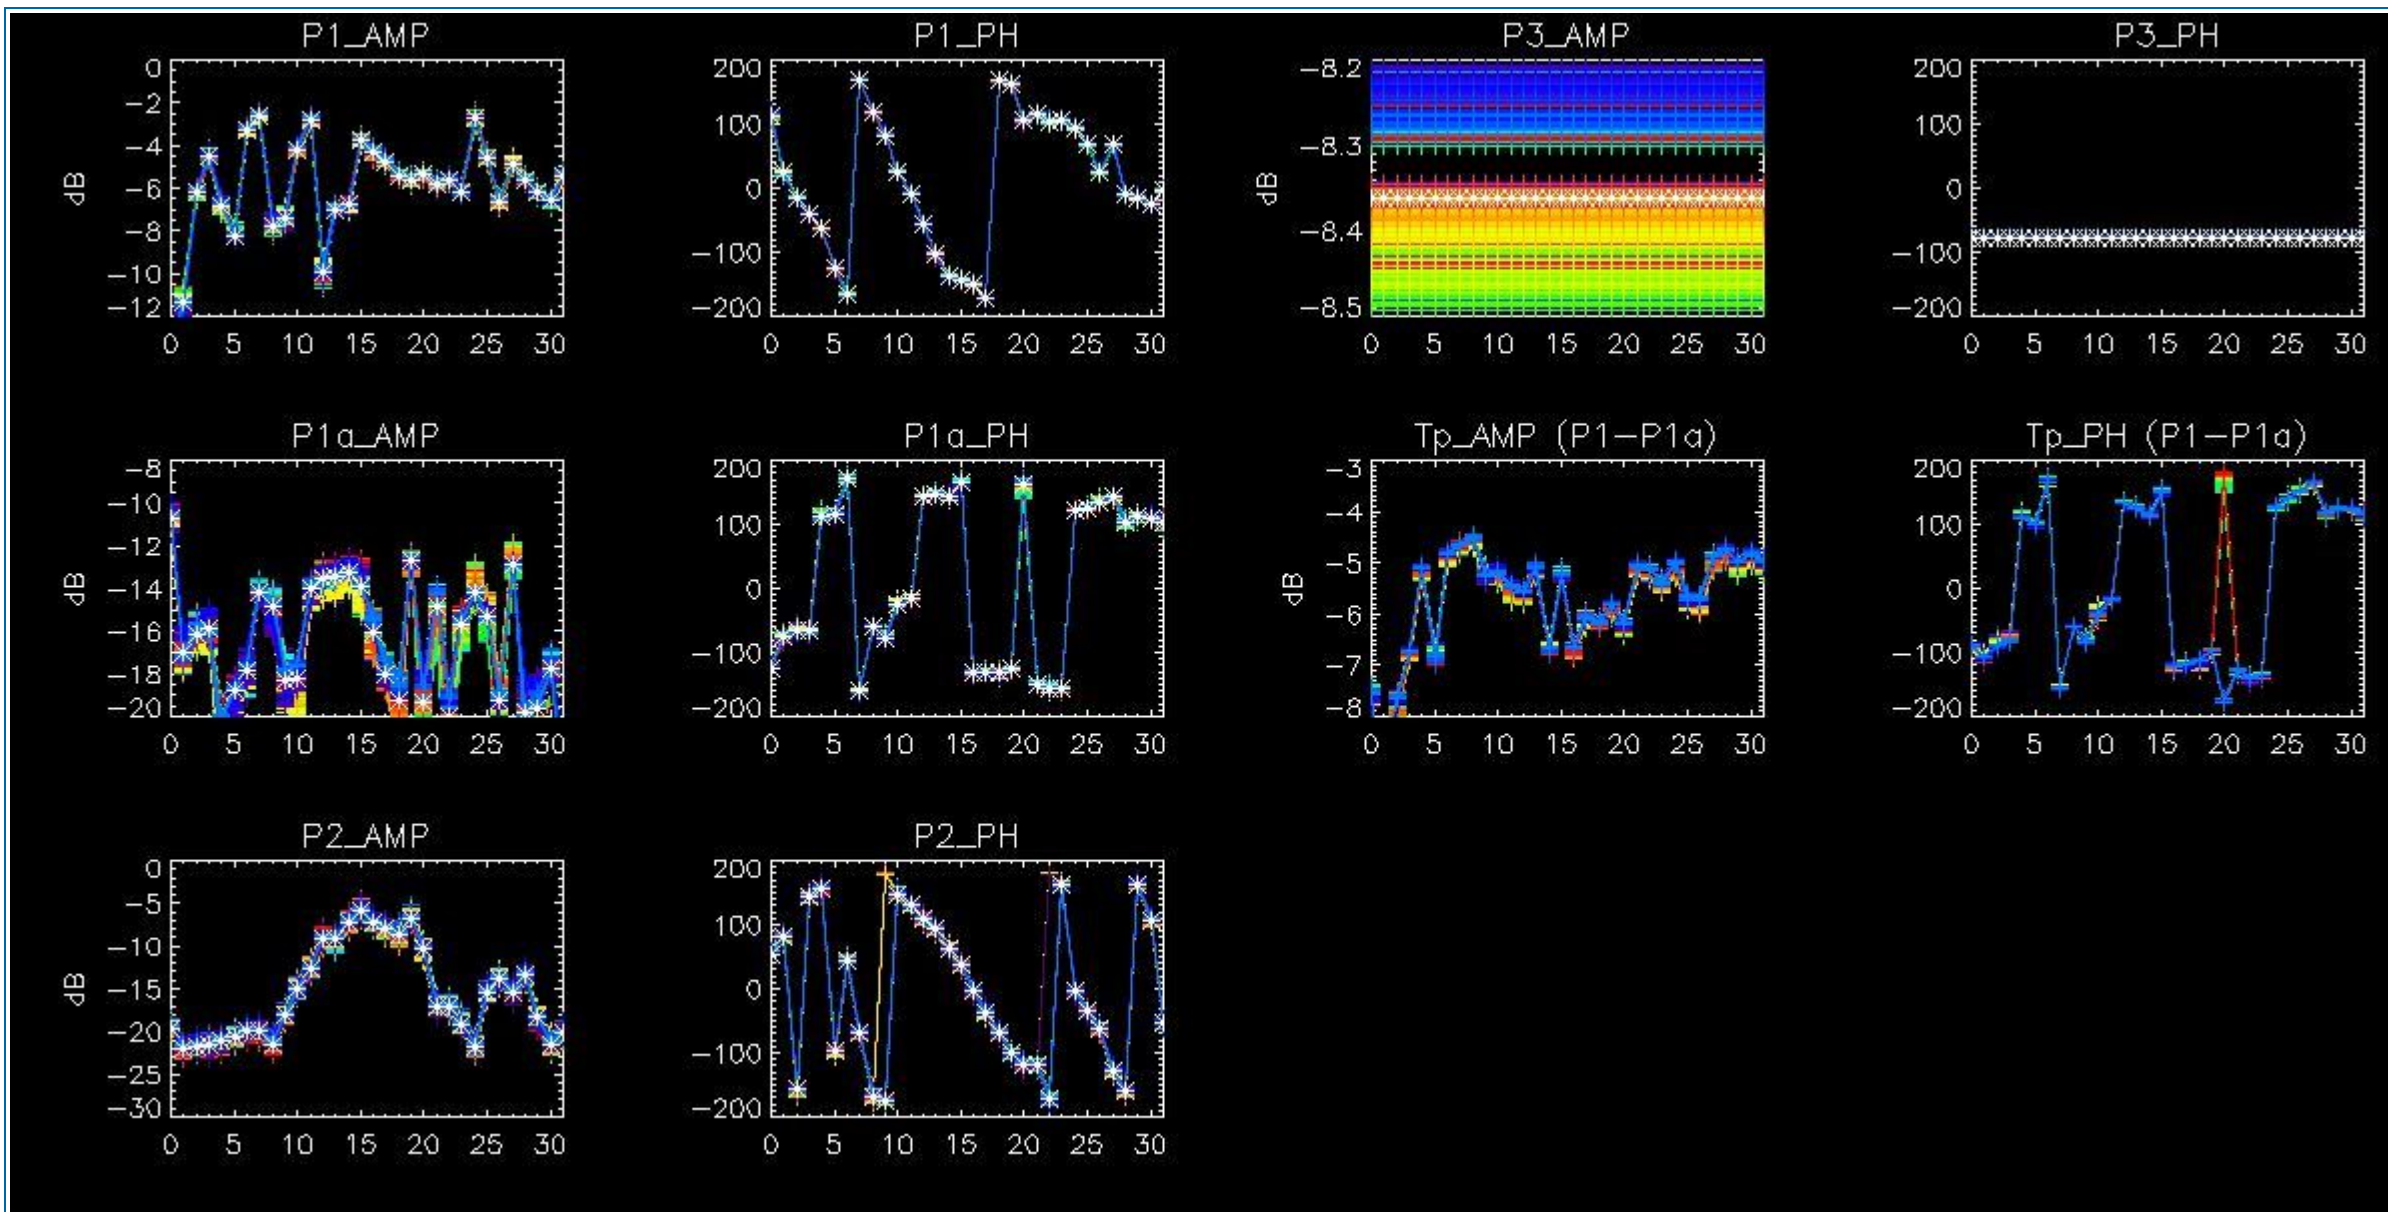

## 4.2 - Analysis for GM1 SS3 H/H

### 4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H


[ BACK TO MENU ]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]



Calibration pulses for GM1 SS3 H/H

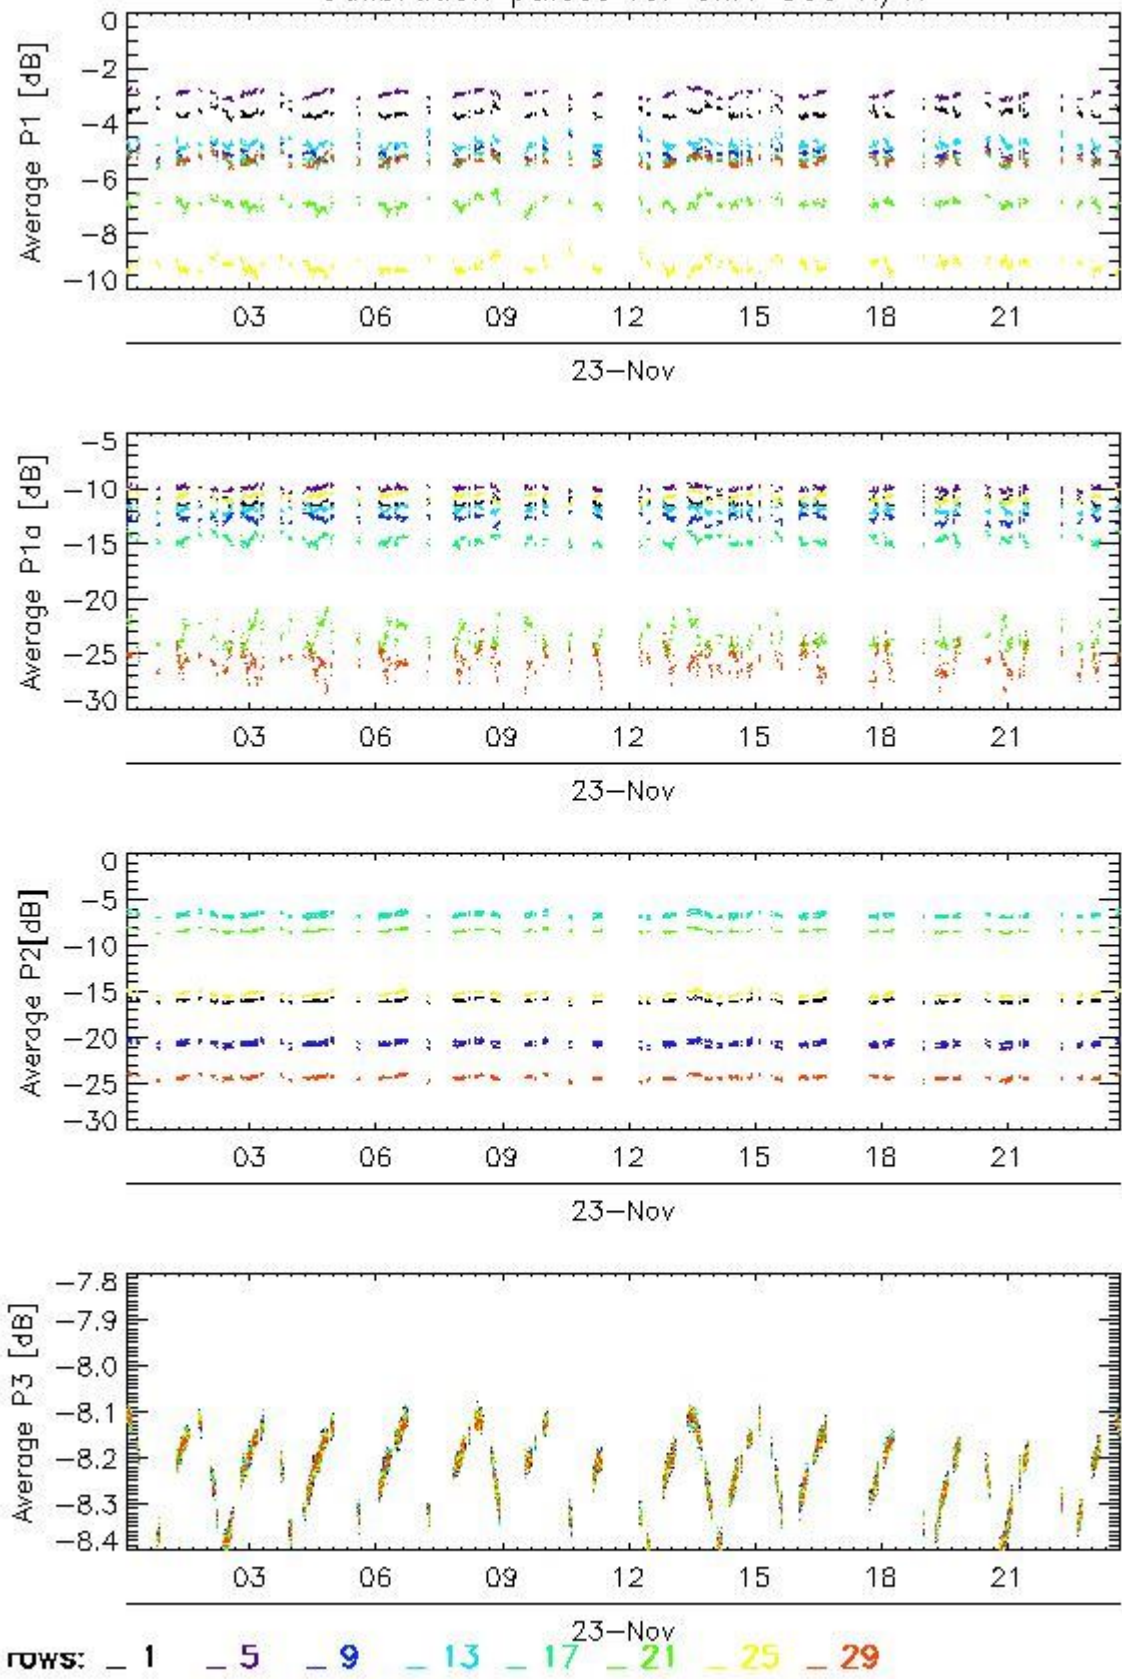


Transmit power (P1 - P1a) for GM1 SS3 H/H

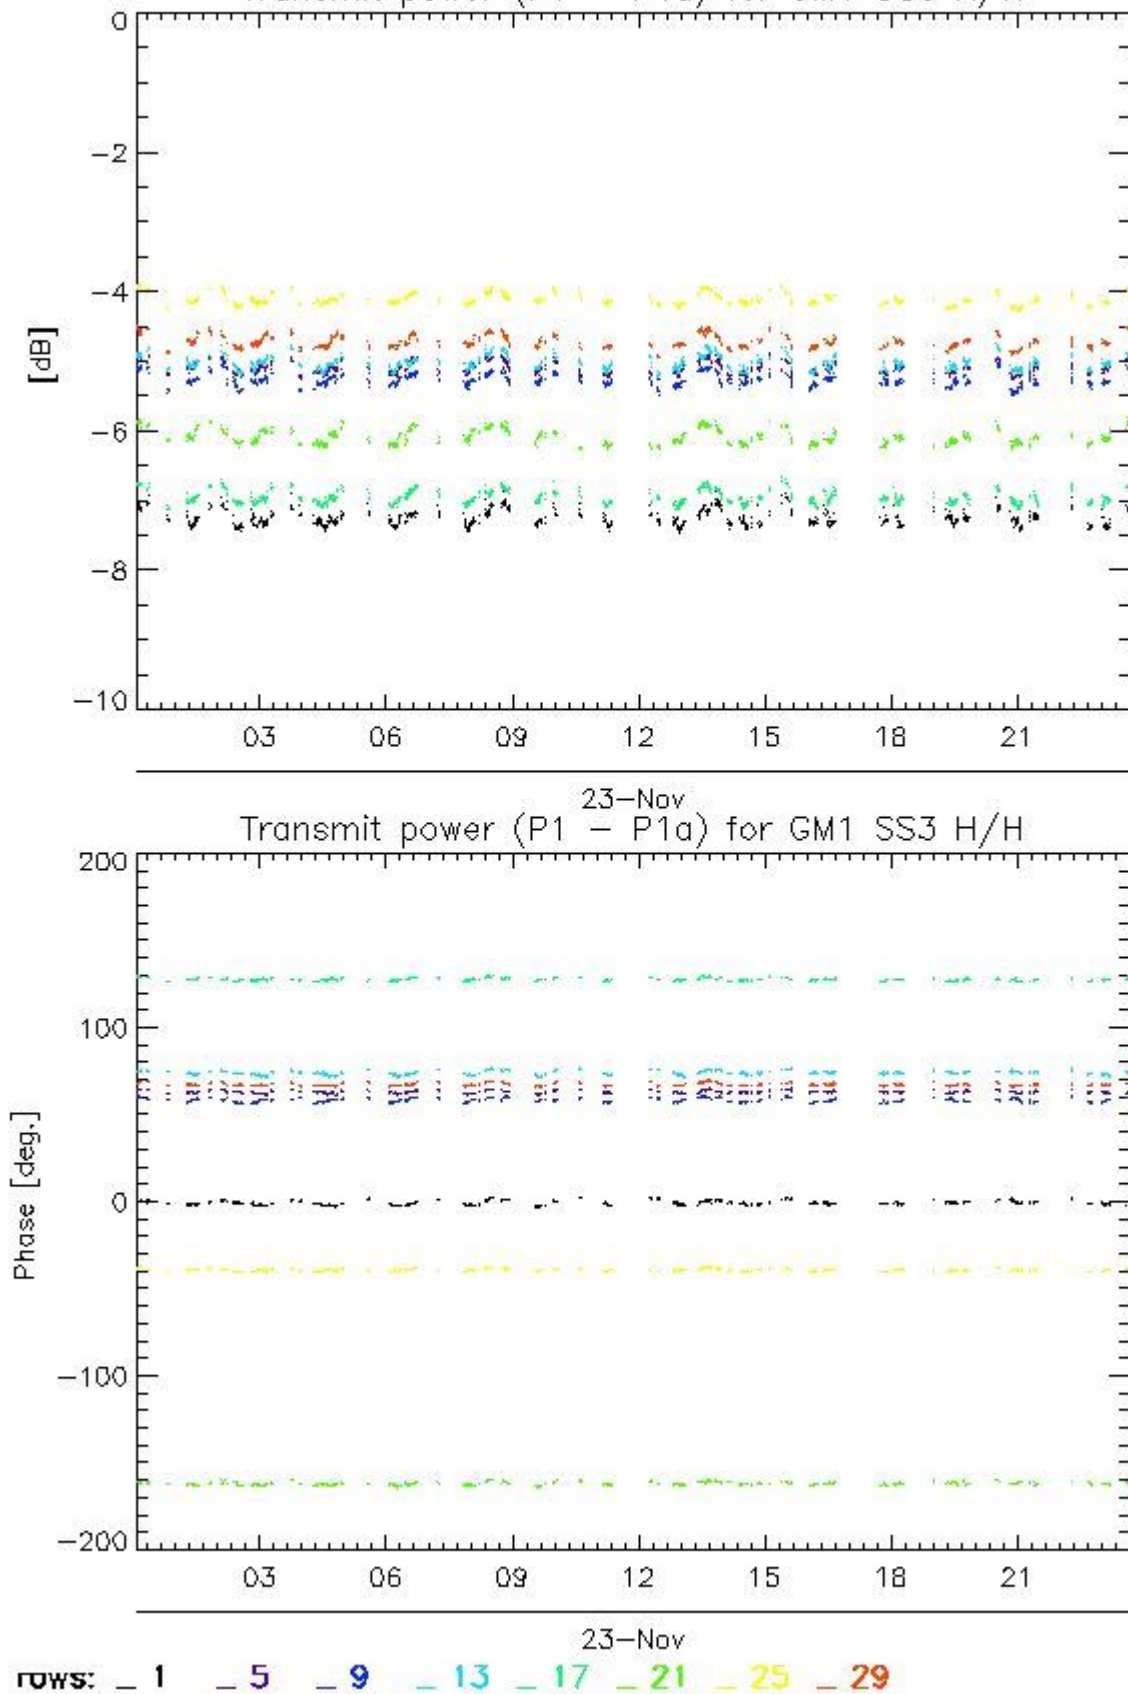

4.2.2 - All Rows Analysis for GM1 SS3 H/H

[ BACK TO MENU ]



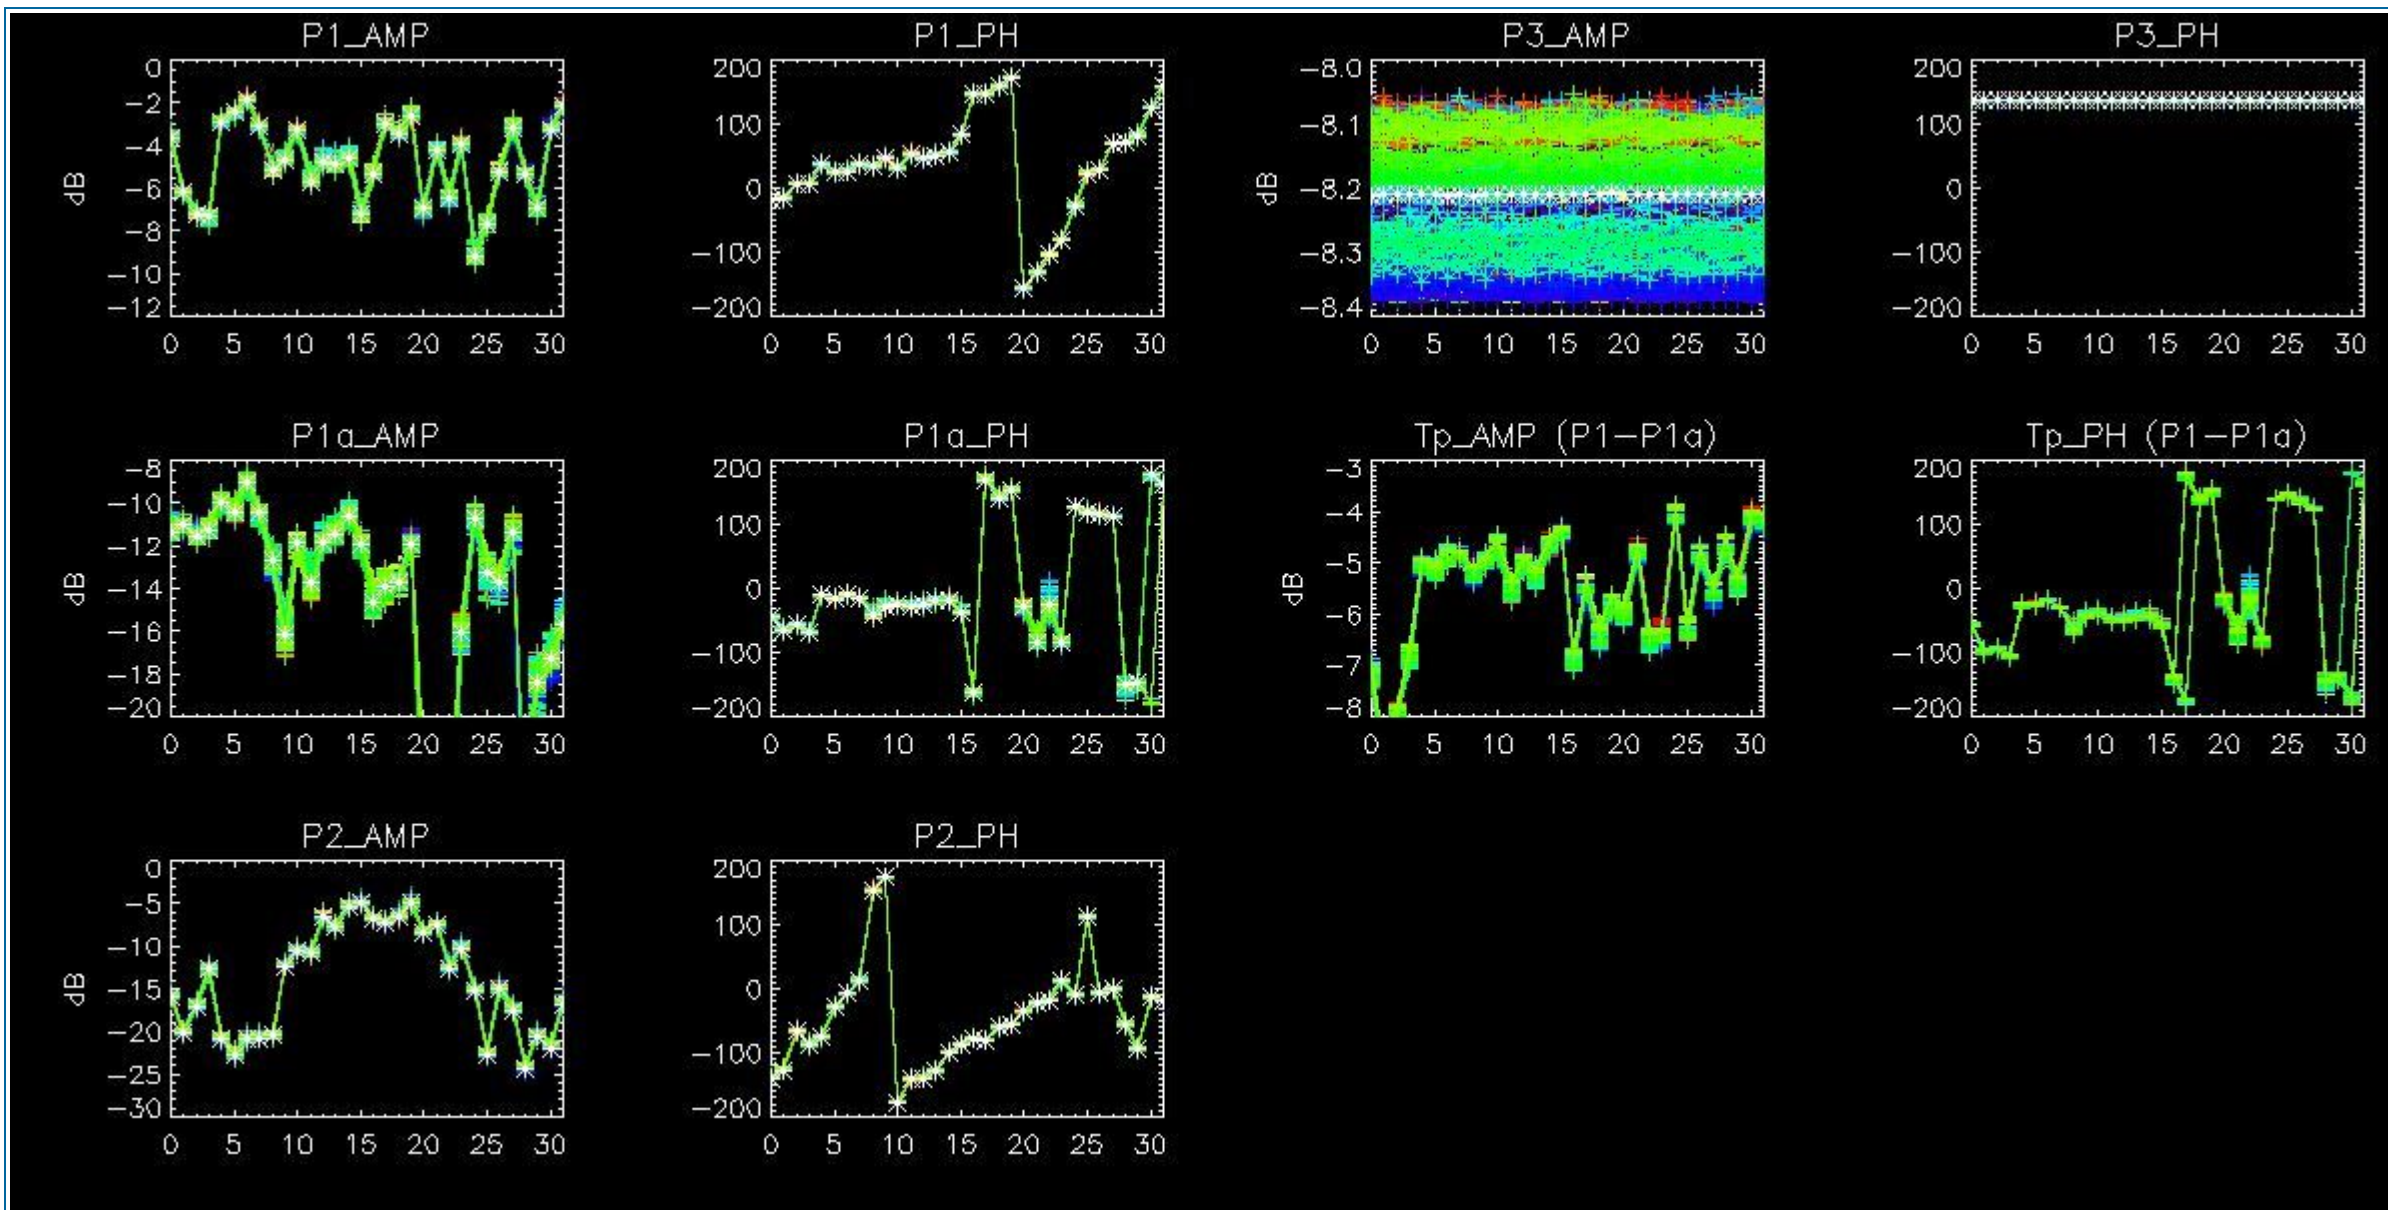


## 5 - DOPPLER ANALYSIS

### 5.1 - Analysis for WVS IS2 V/V

#### 5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[ [BACK TO MENU](#) ]




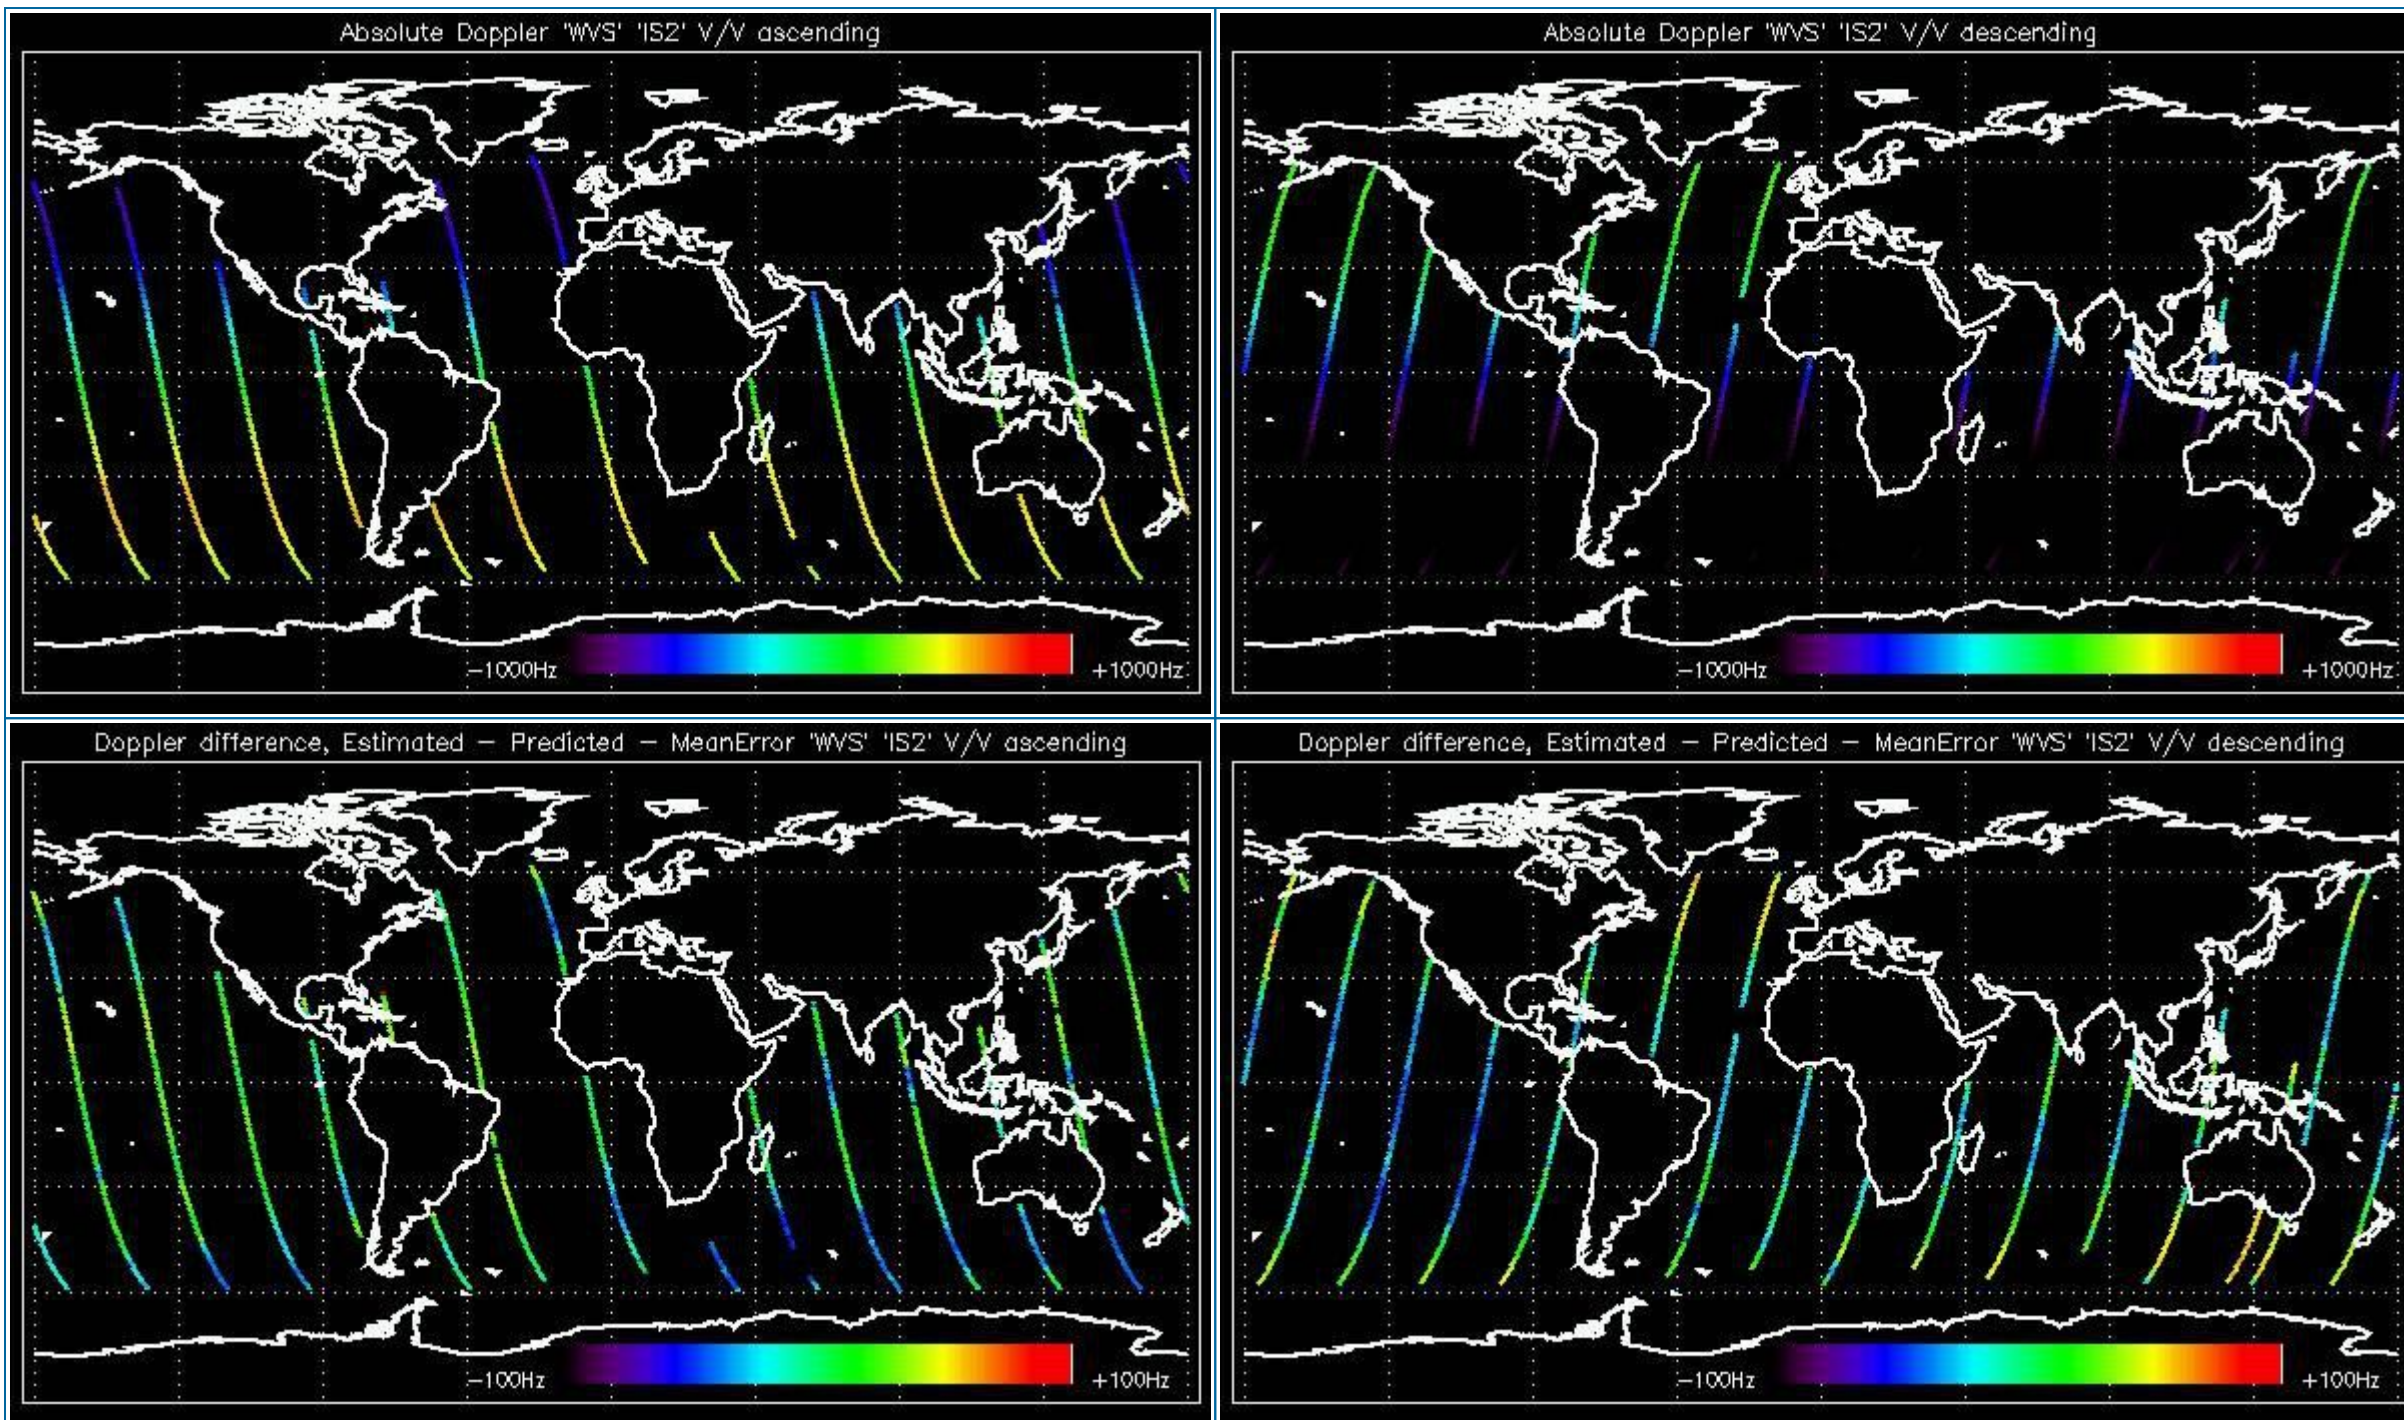

### 5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[ [BACK TO MENU](#) ]



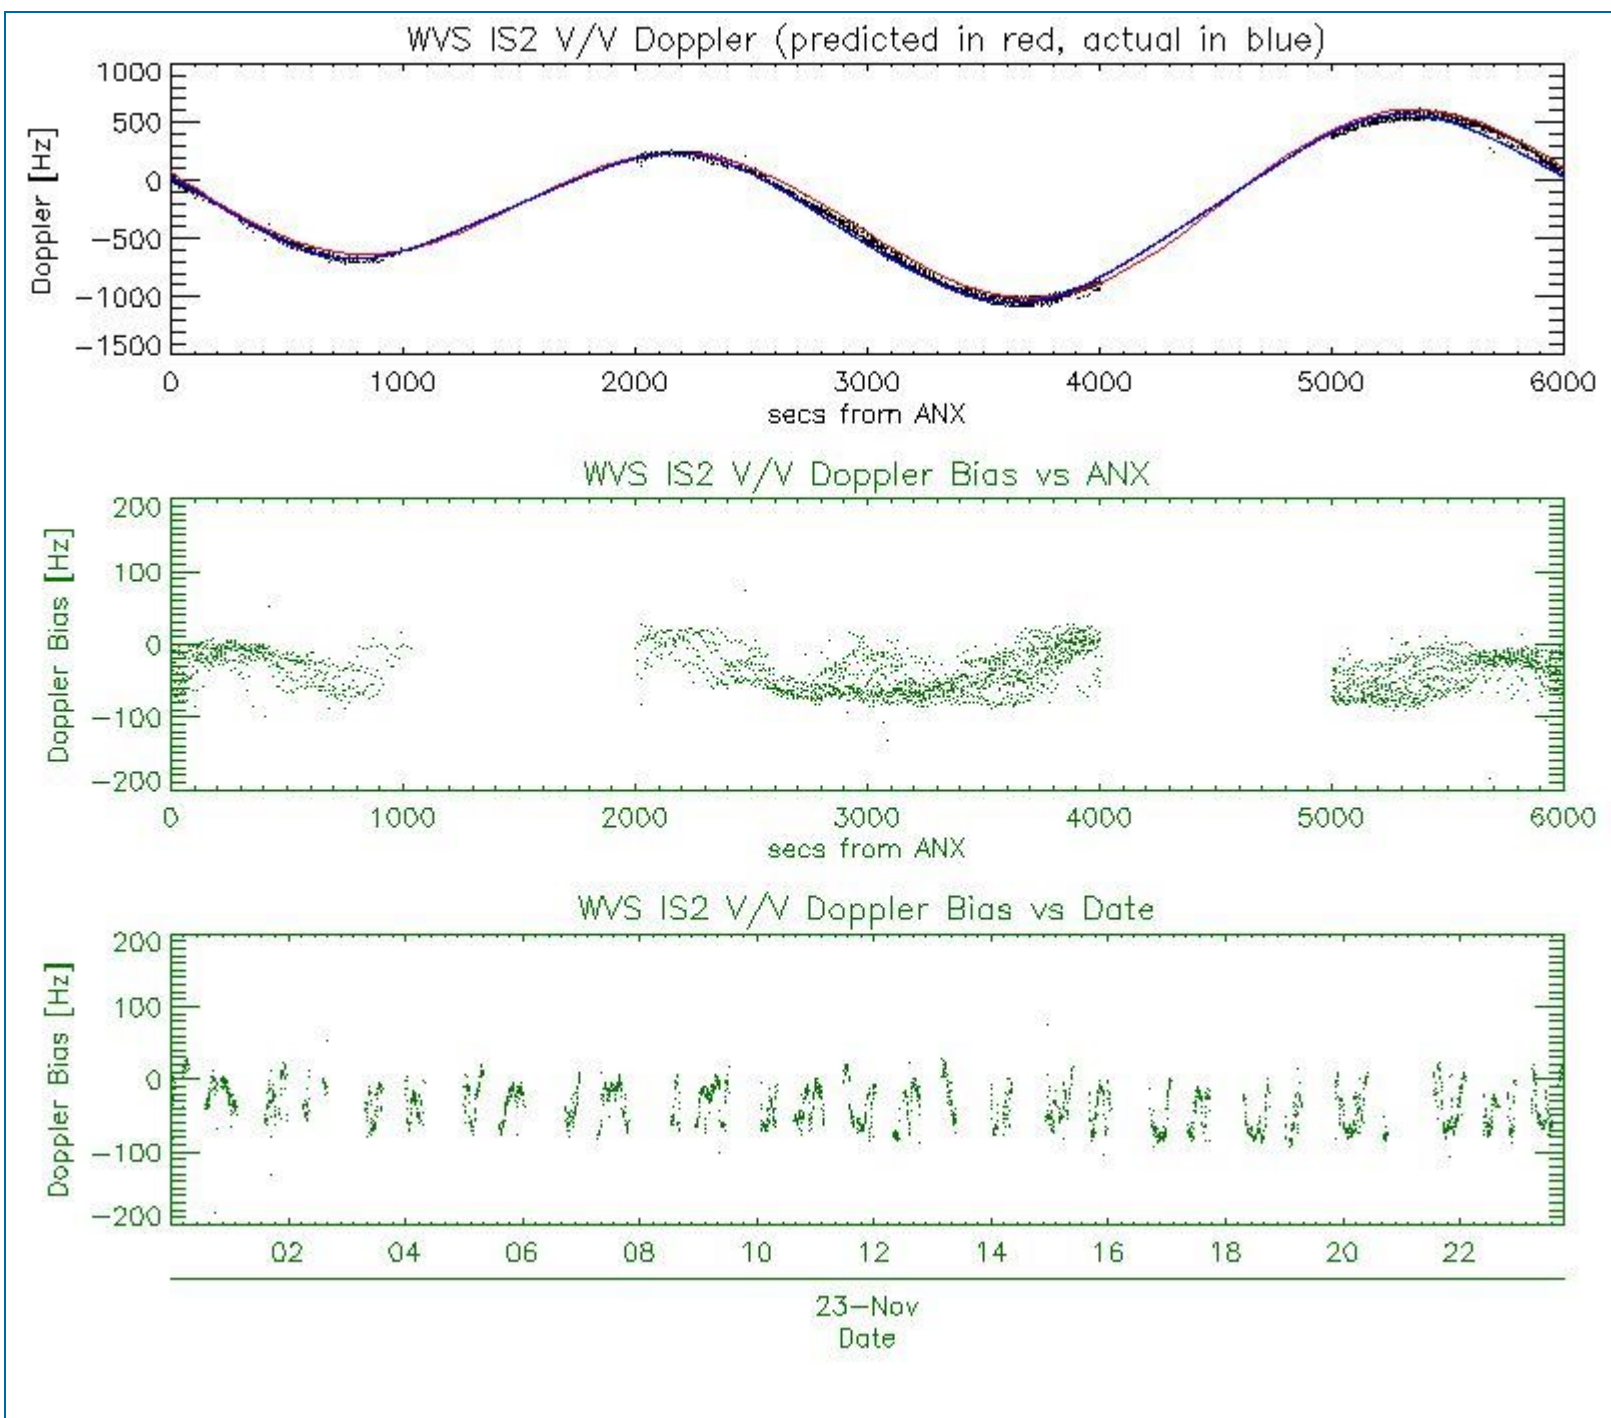


## 5.2 - Analysis for GM1 SS1 H/H

### 5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[ [BACK TO MENU](#) ]




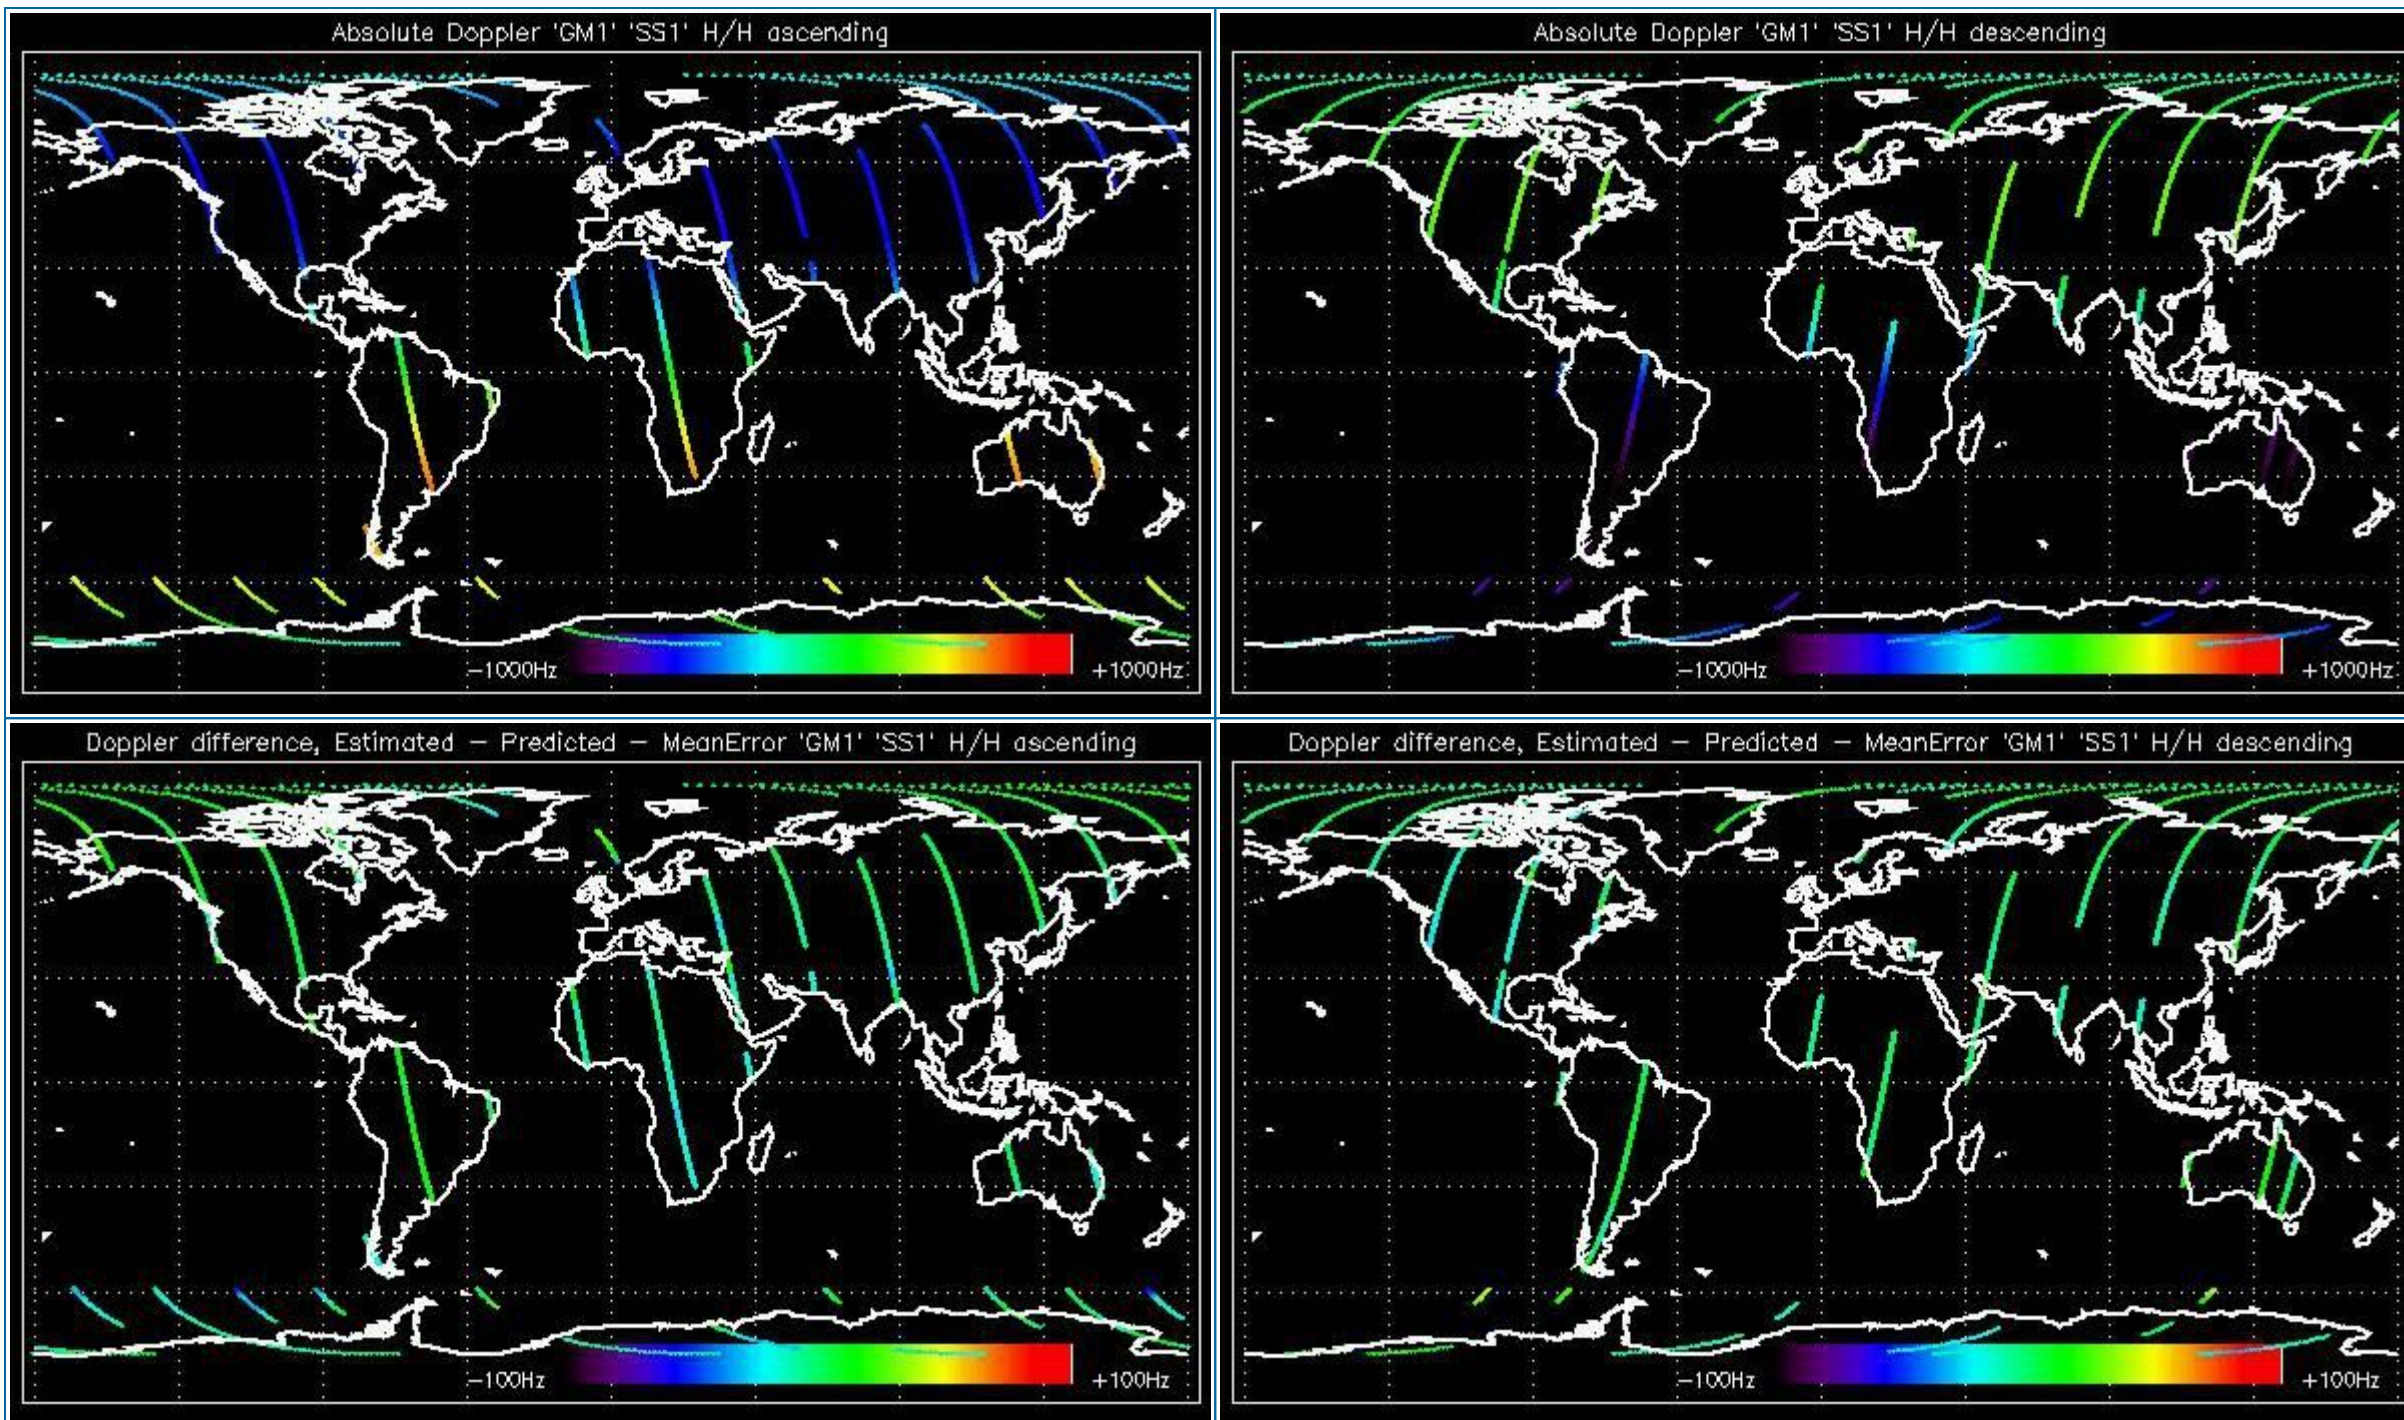

### 5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[ [BACK TO MENU](#) ]




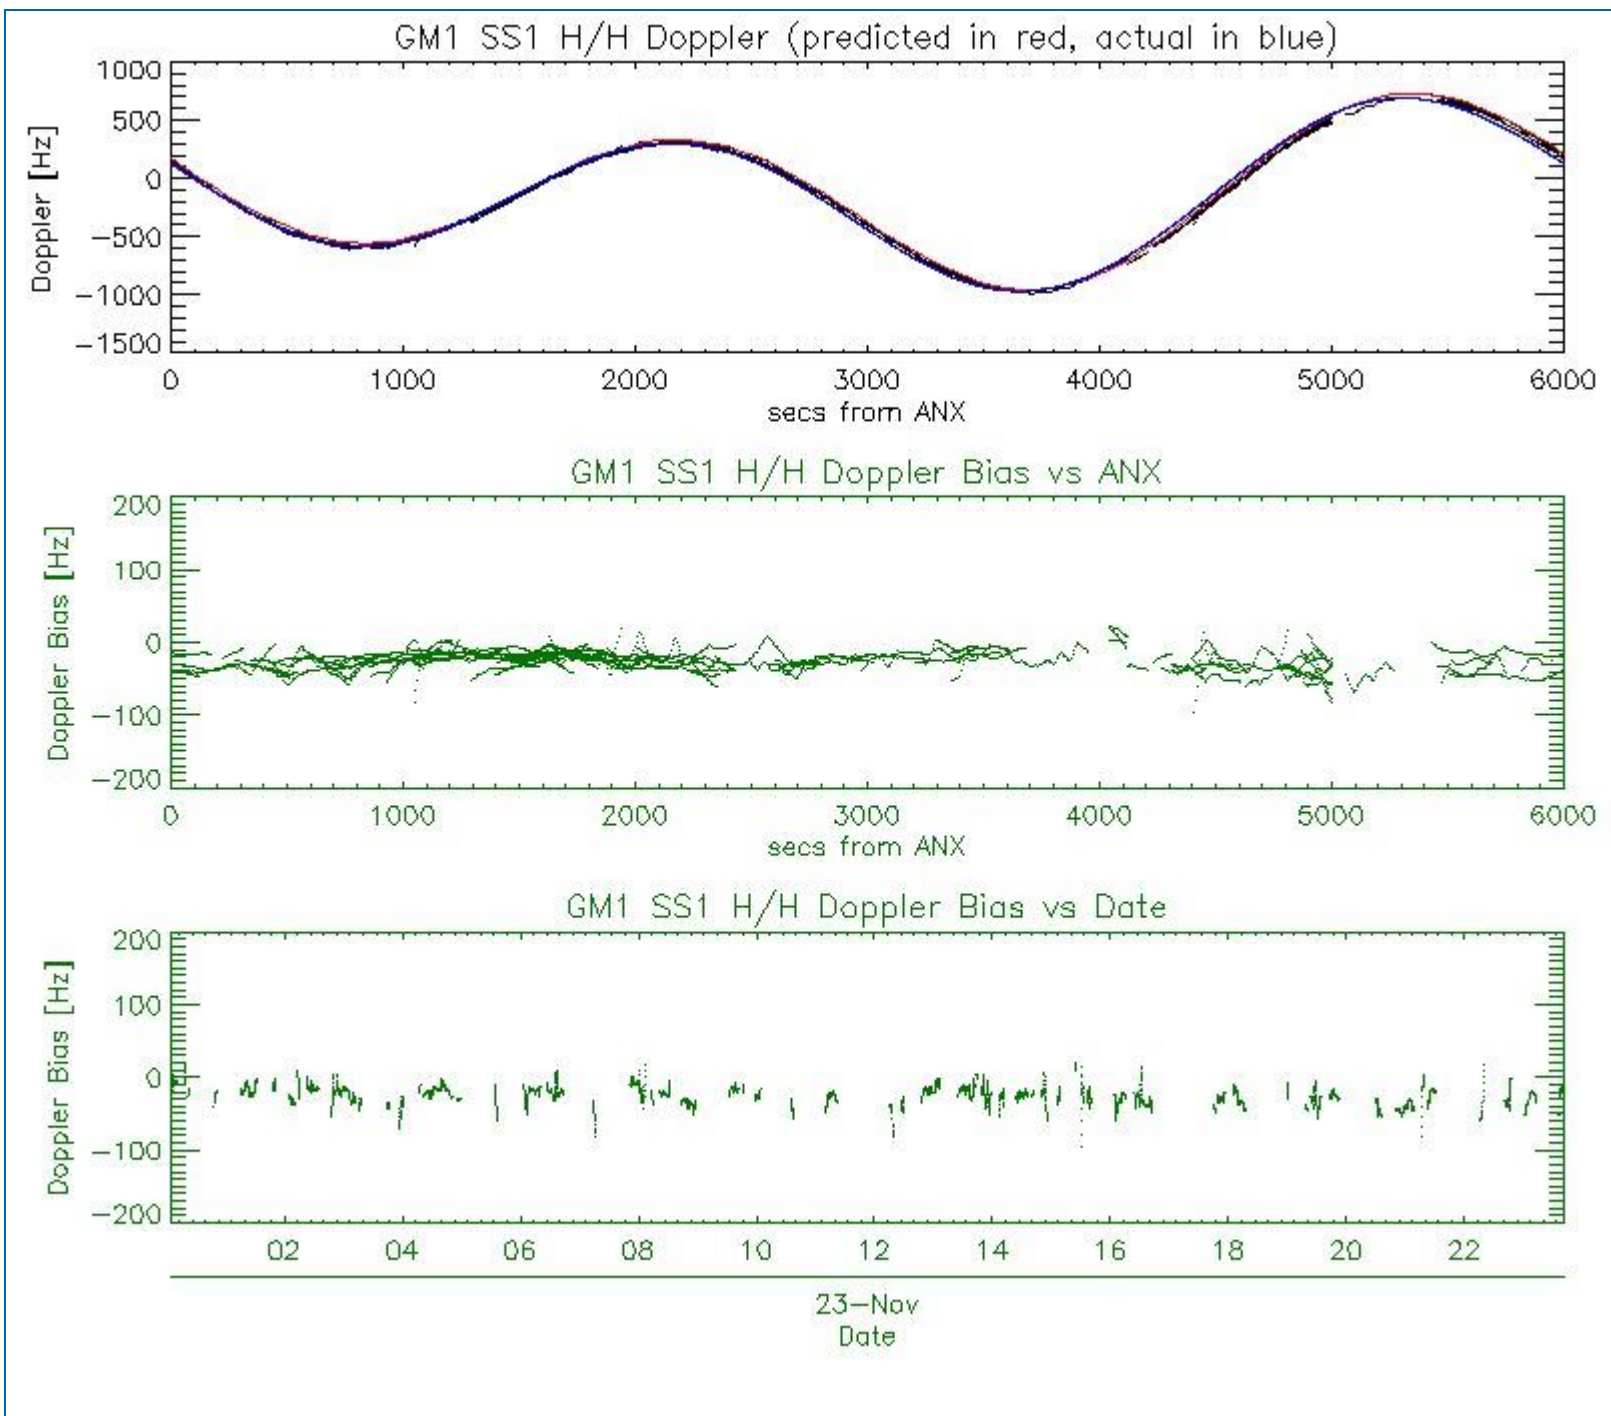

### 5.3 - Doppler JUMPS Analysis for WSM

[ BACK TO MENU ]



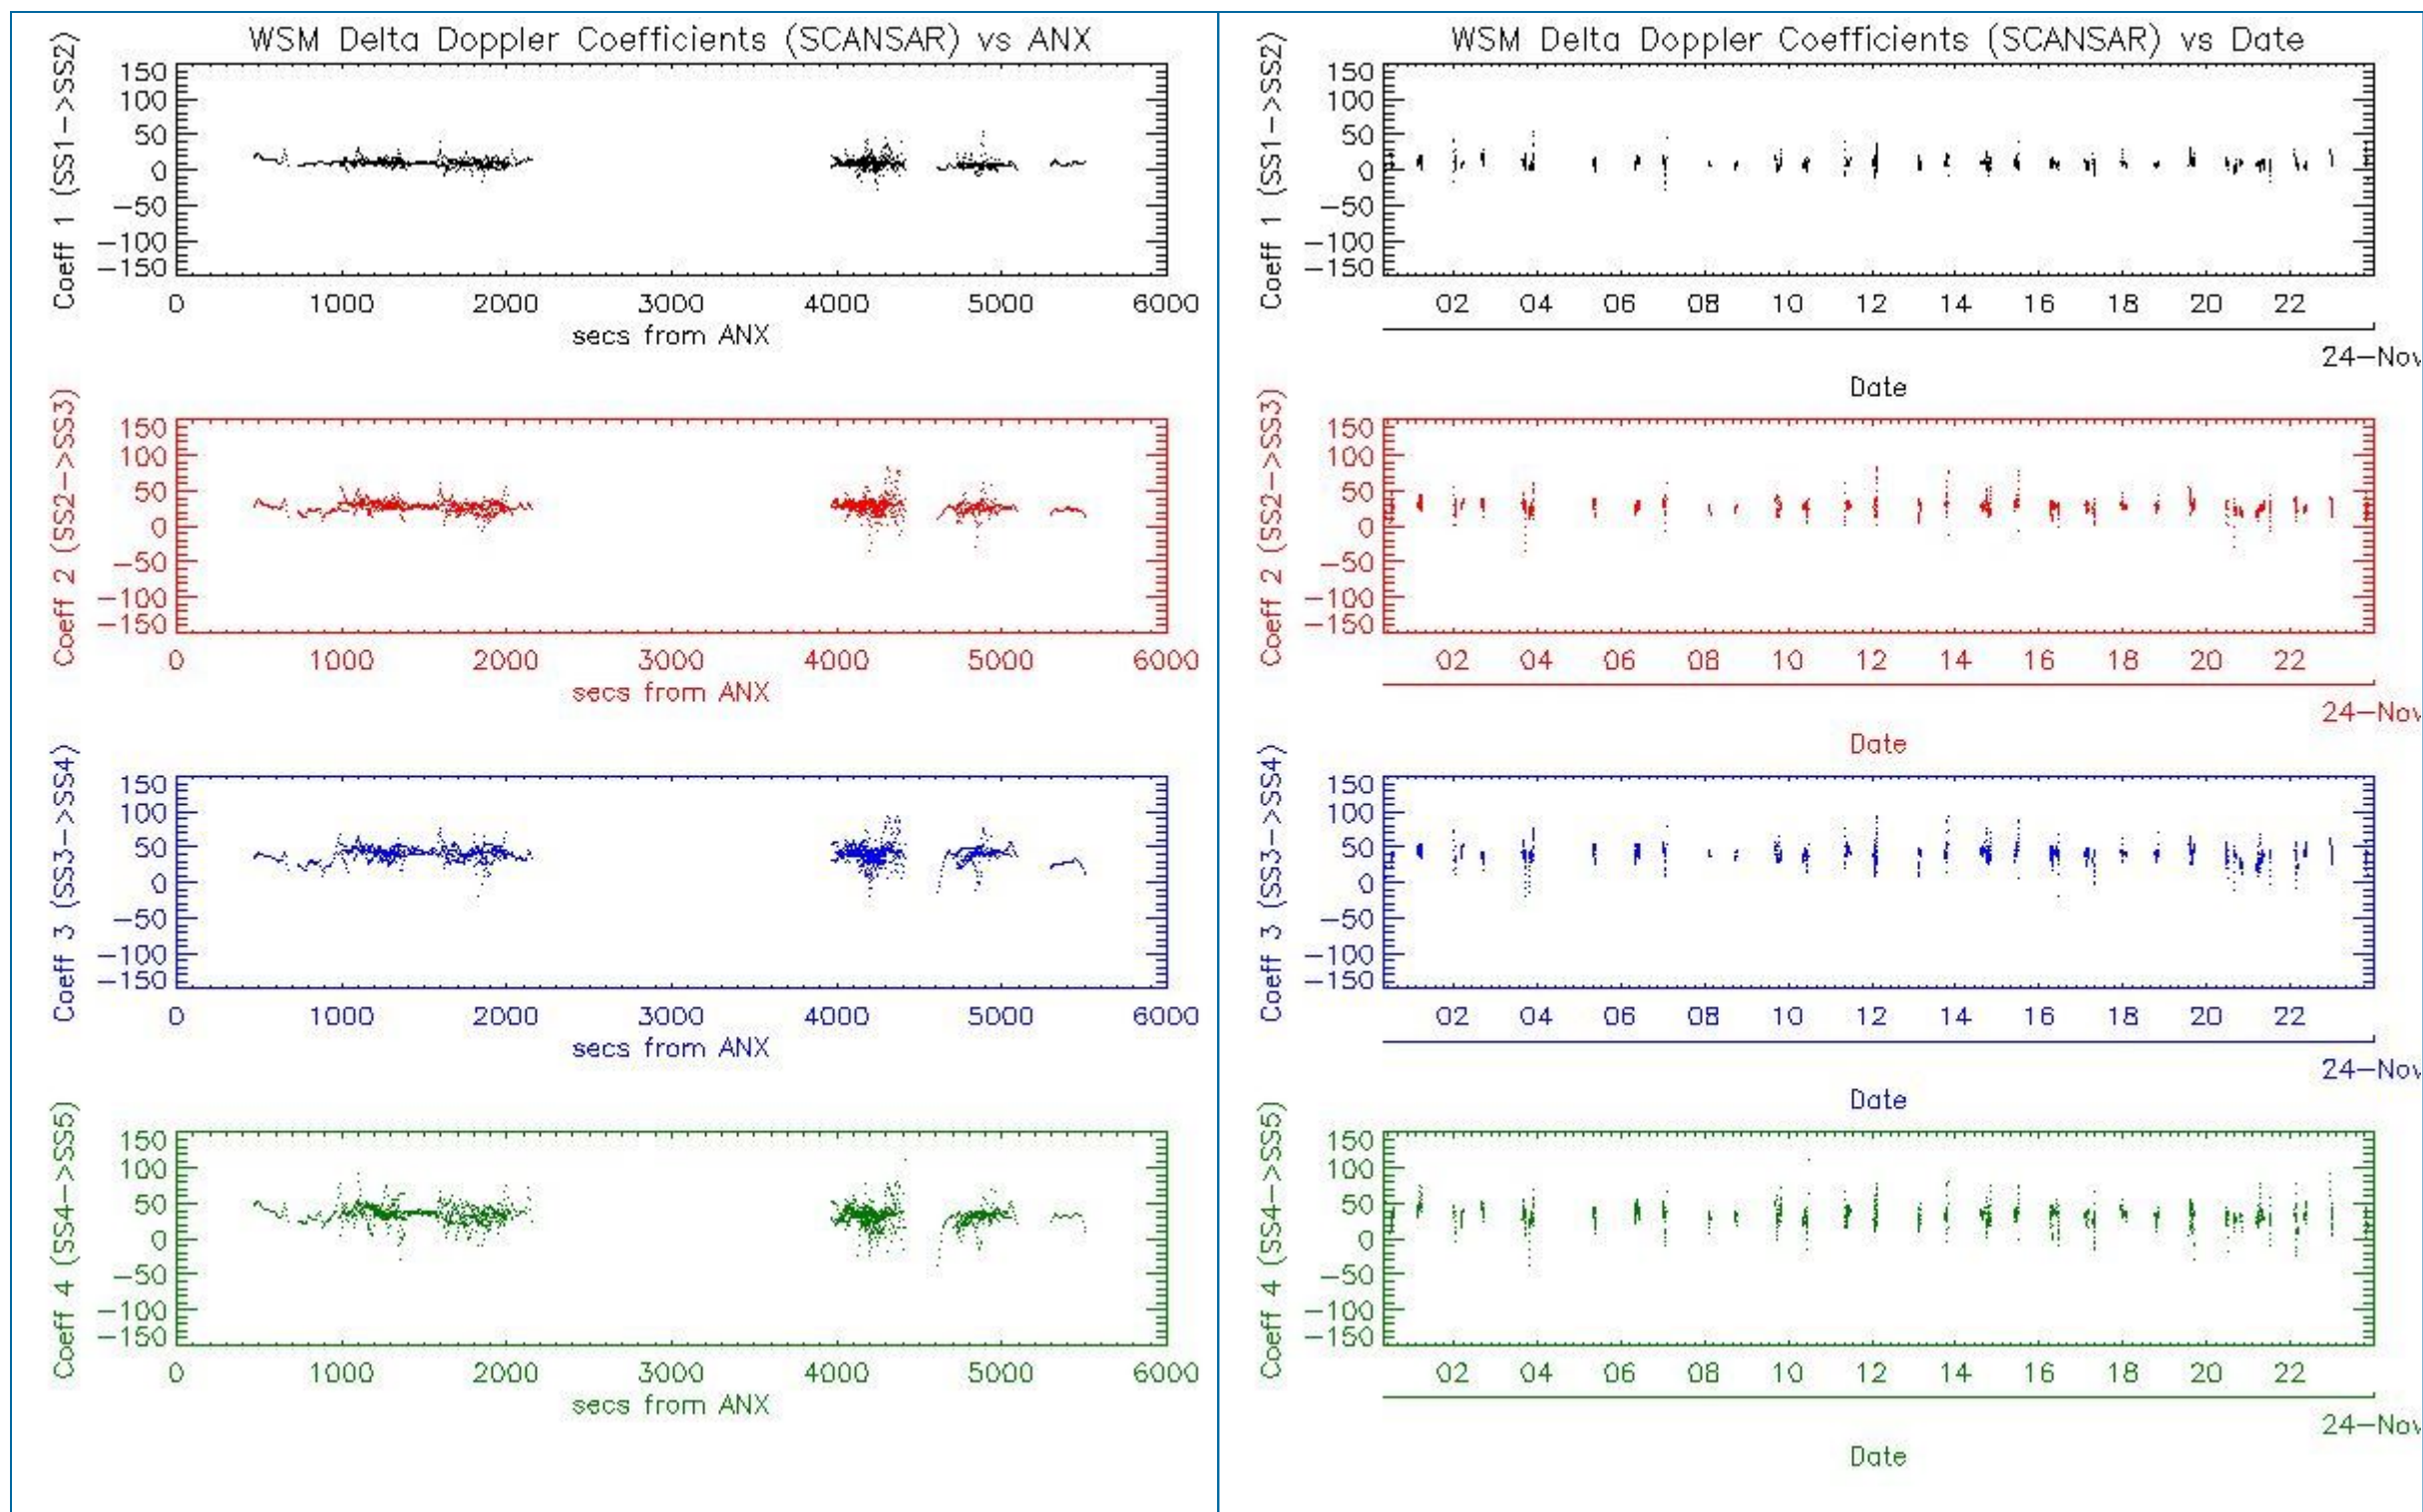



## 6 - CHIRP ANALYSIS

### 6.1 - Analysis for WSM SS1 H/H

#### 6.1.1 - ScaleFactor

[ BACK TO MENU ]




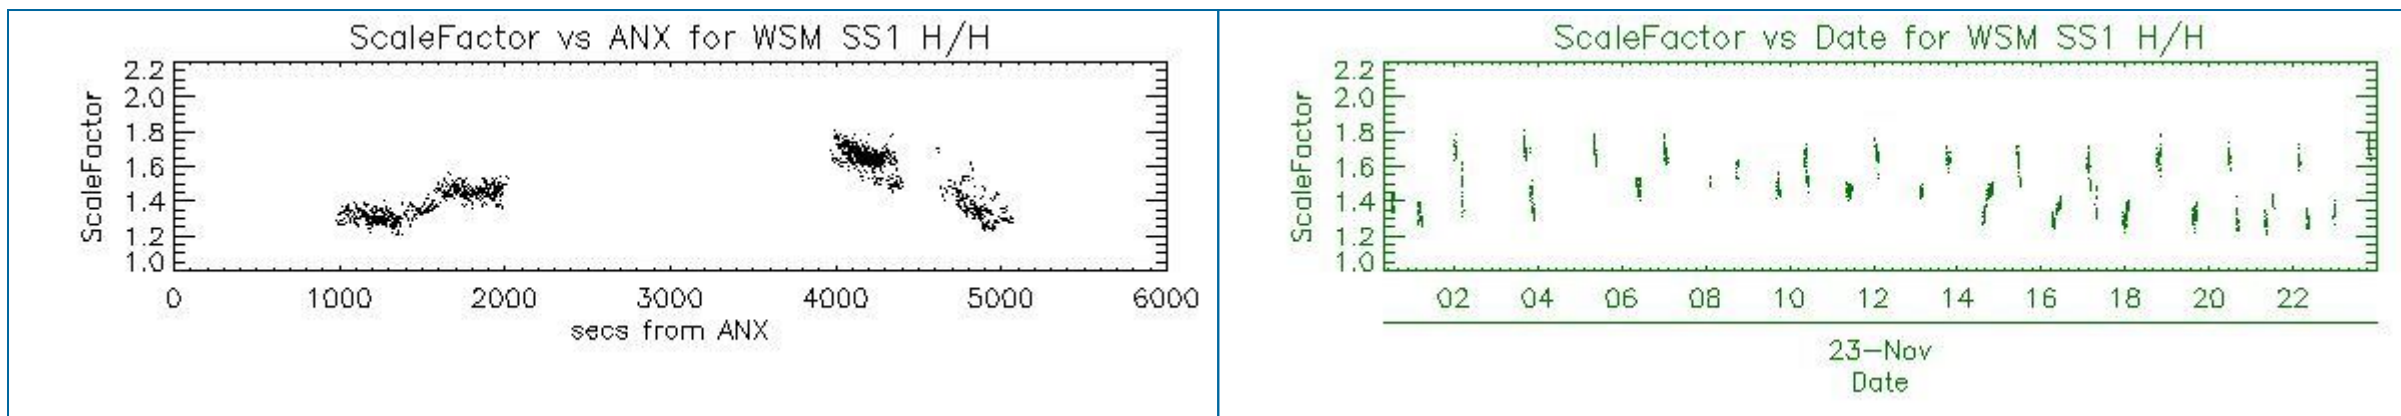

## 6.2 - Analysis for WSM SS1 V/V

### 6.2.1 - ScaleFactor

[ [BACK TO MENU](#) ]

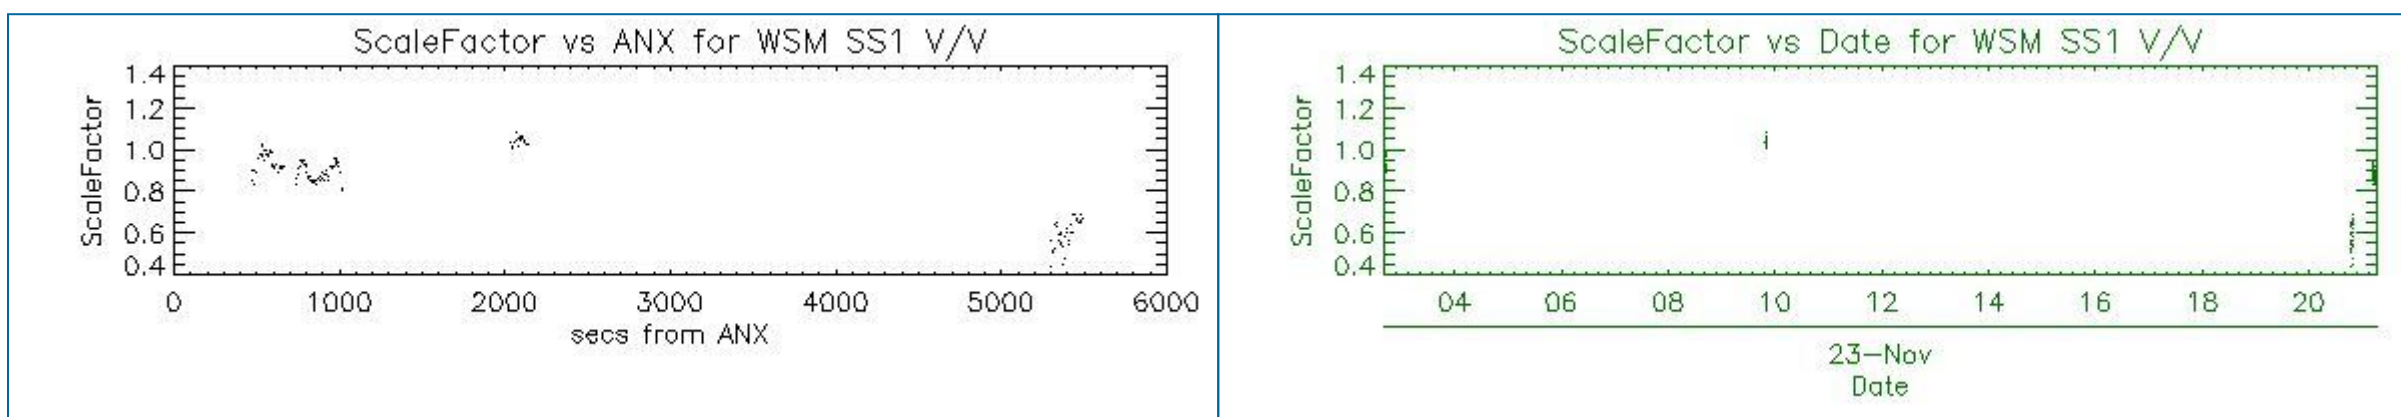




## 7 - RAW DATA ANALYSIS

### 7.1 - Analysis for WVS

[ [BACK TO MENU](#) ]

--	--	--



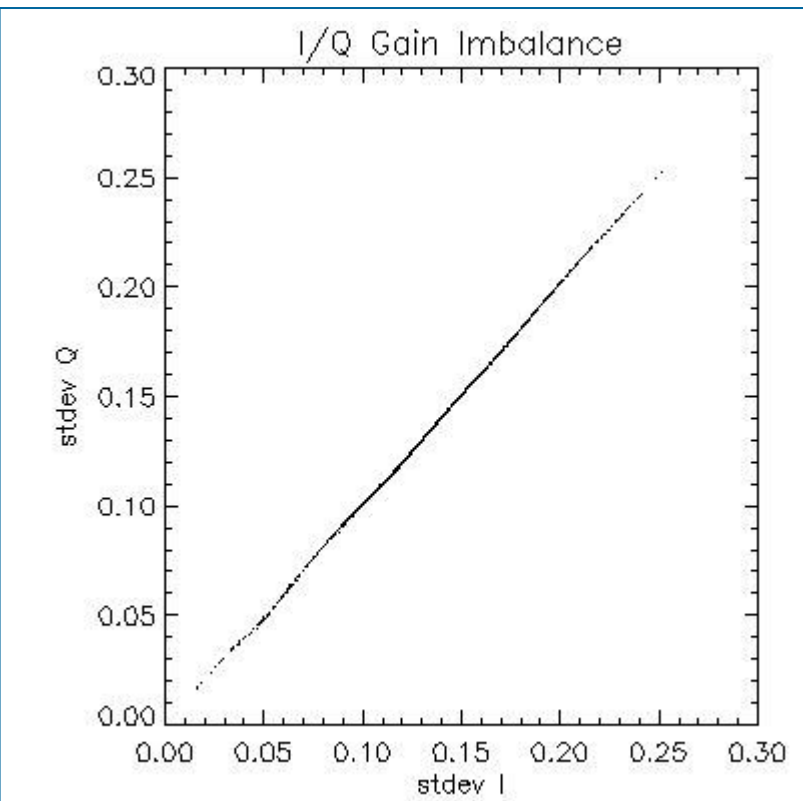
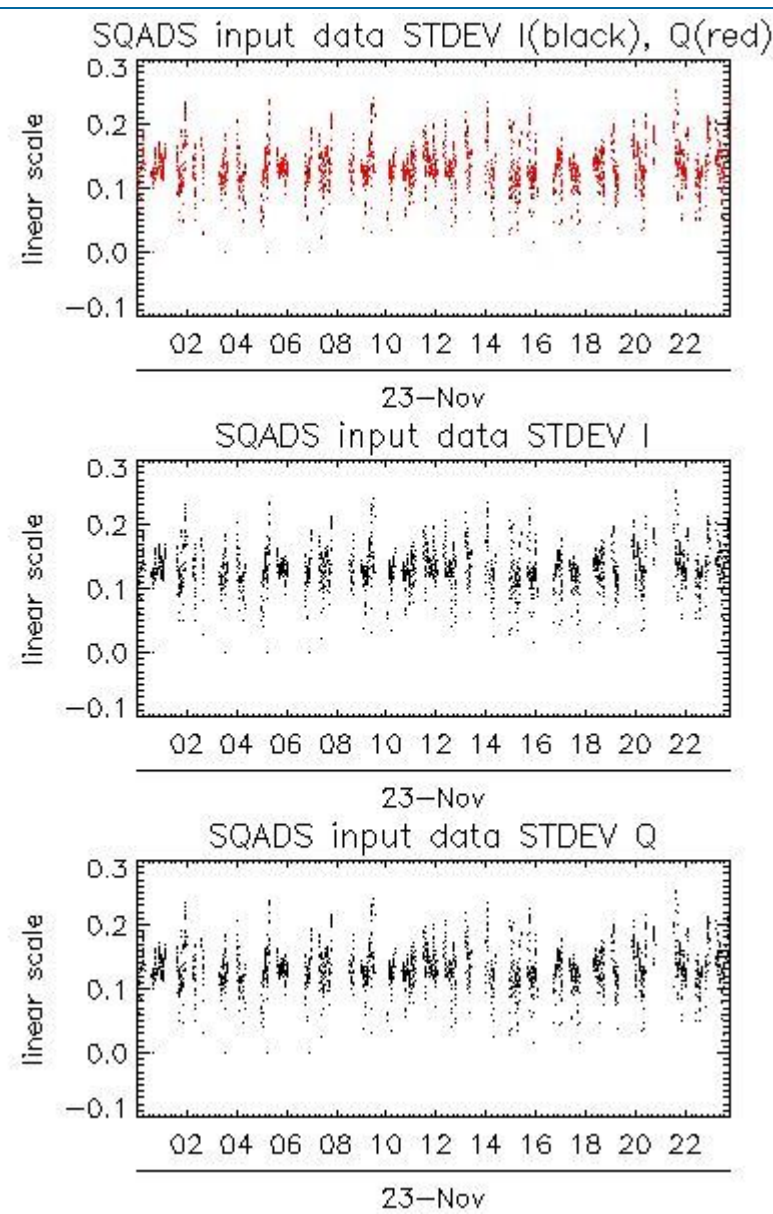
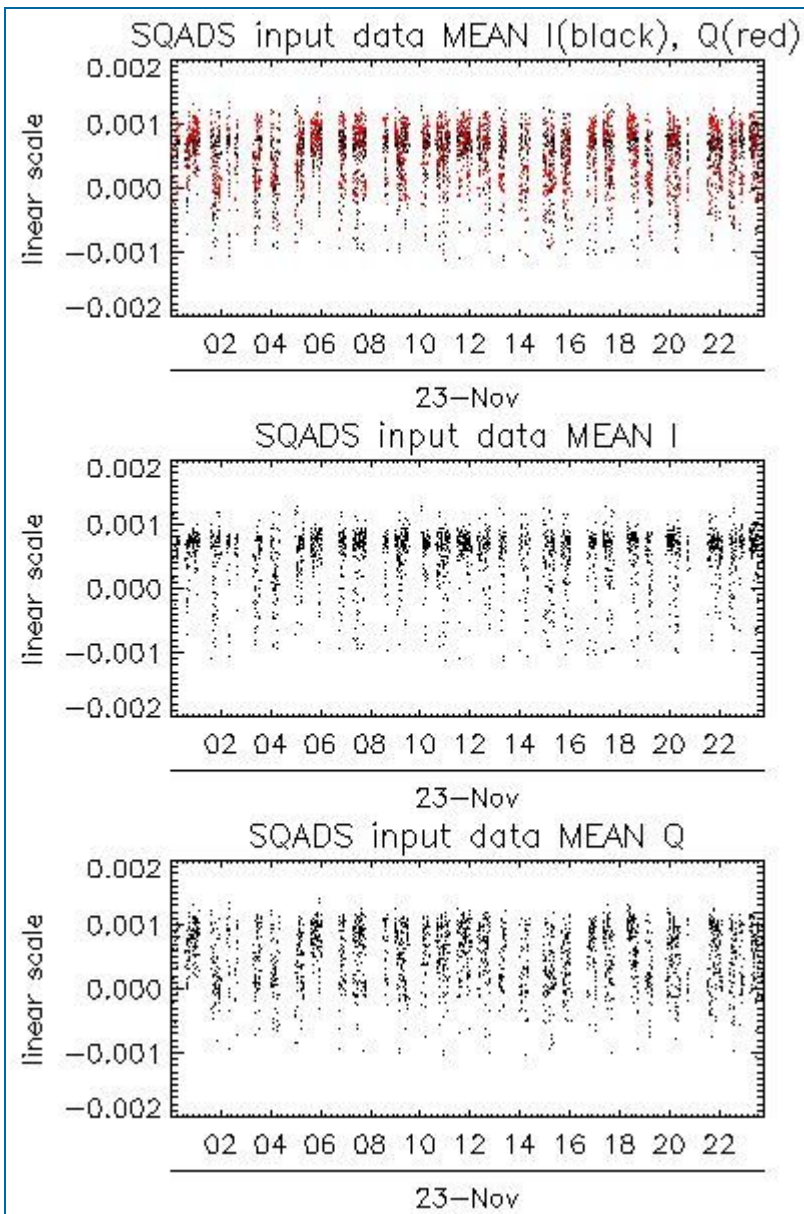


Channel	Statistics	DSS-B
MEAN I	mean	0.000506098
	stdev	1.95802e-07
MEAN Q	mean	0.000514137
	stdev	2.14873e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.133096
	stdev	0.00106879
STDEV Q	mean	0.133408
	stdev	0.00108951

7.2 - Analysis for IMM

[ BACK TO MENU ]



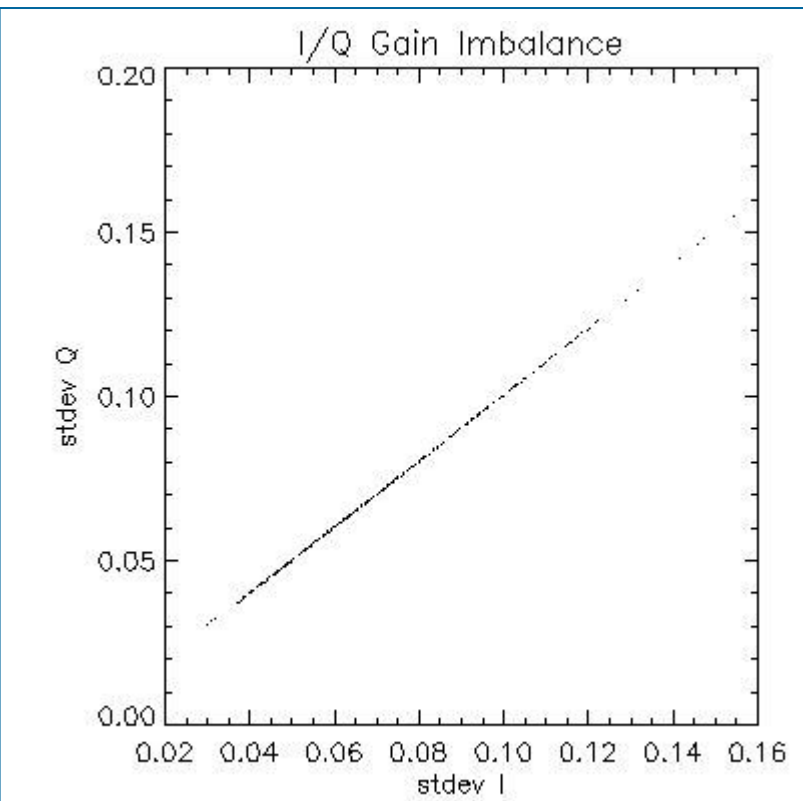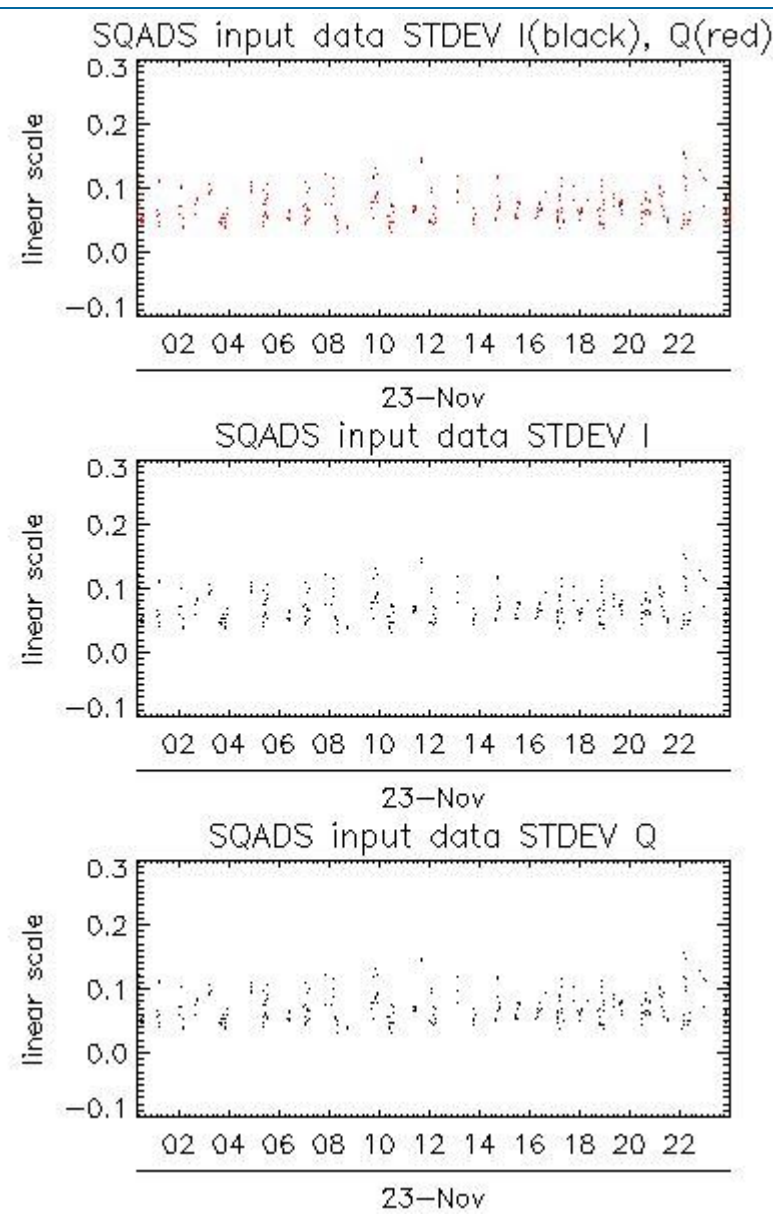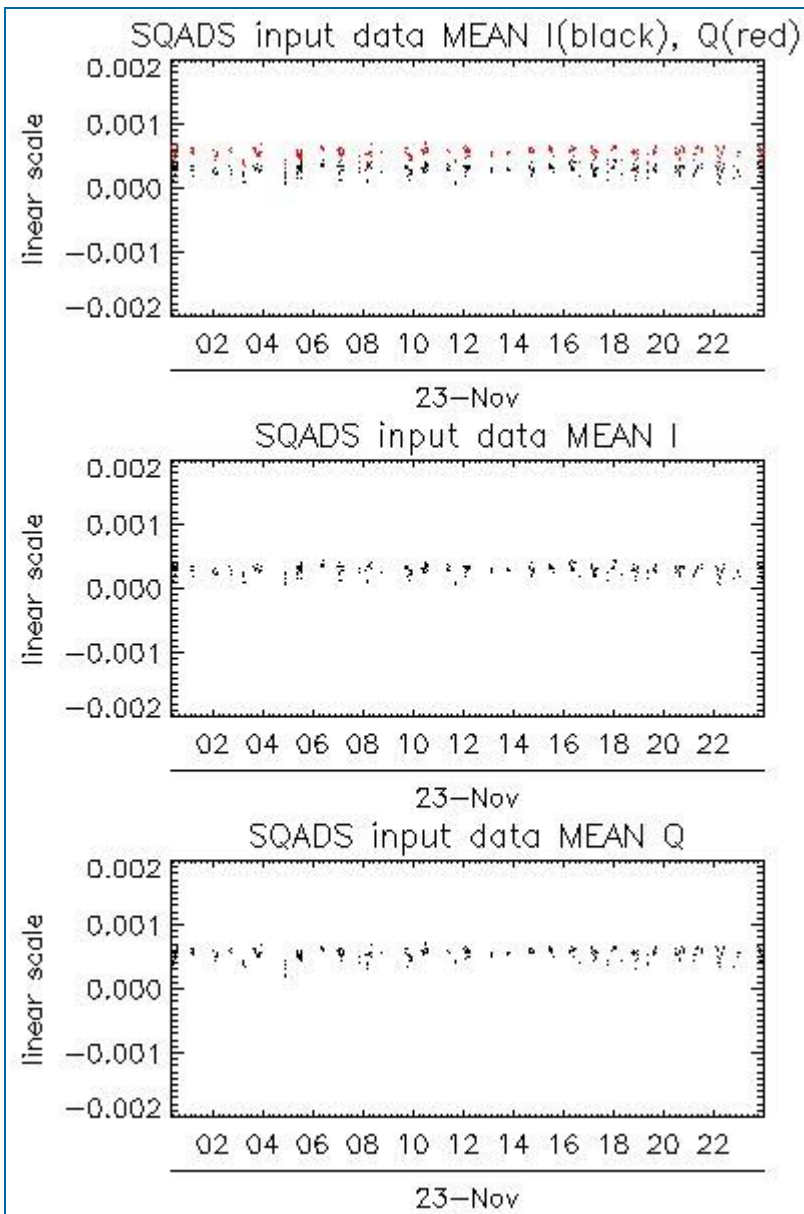



Channel	Statistics	DSS-B
MEAN I	mean	0.000285056
	stdev	5.58434e-09
MEAN Q	mean	0.000547717
	stdev	6.60158e-09
Channel	Statistics	DSS-B
STDEV I	mean	0.0697313
	stdev	0.000578251
STDEV Q	mean	0.0700289
	stdev	0.000585017

## 8 - TELEMETRY ANALYSIS

### 8.1 - Number of Missing lines


[ [BACK TO MENU](#) ]



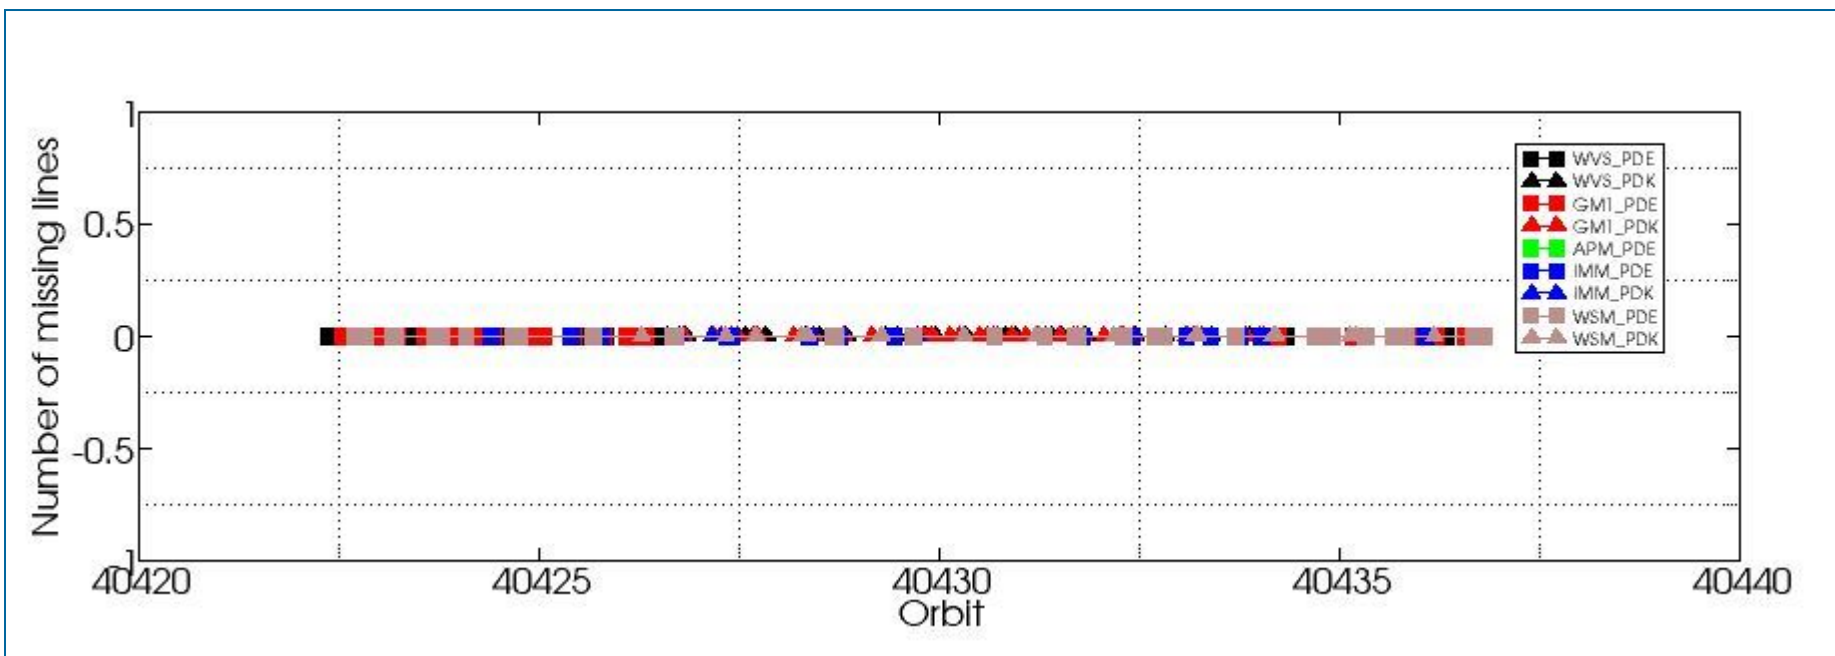

## 8.2 - Number of Gaps

[\[ BACK TO MENU \]](#)

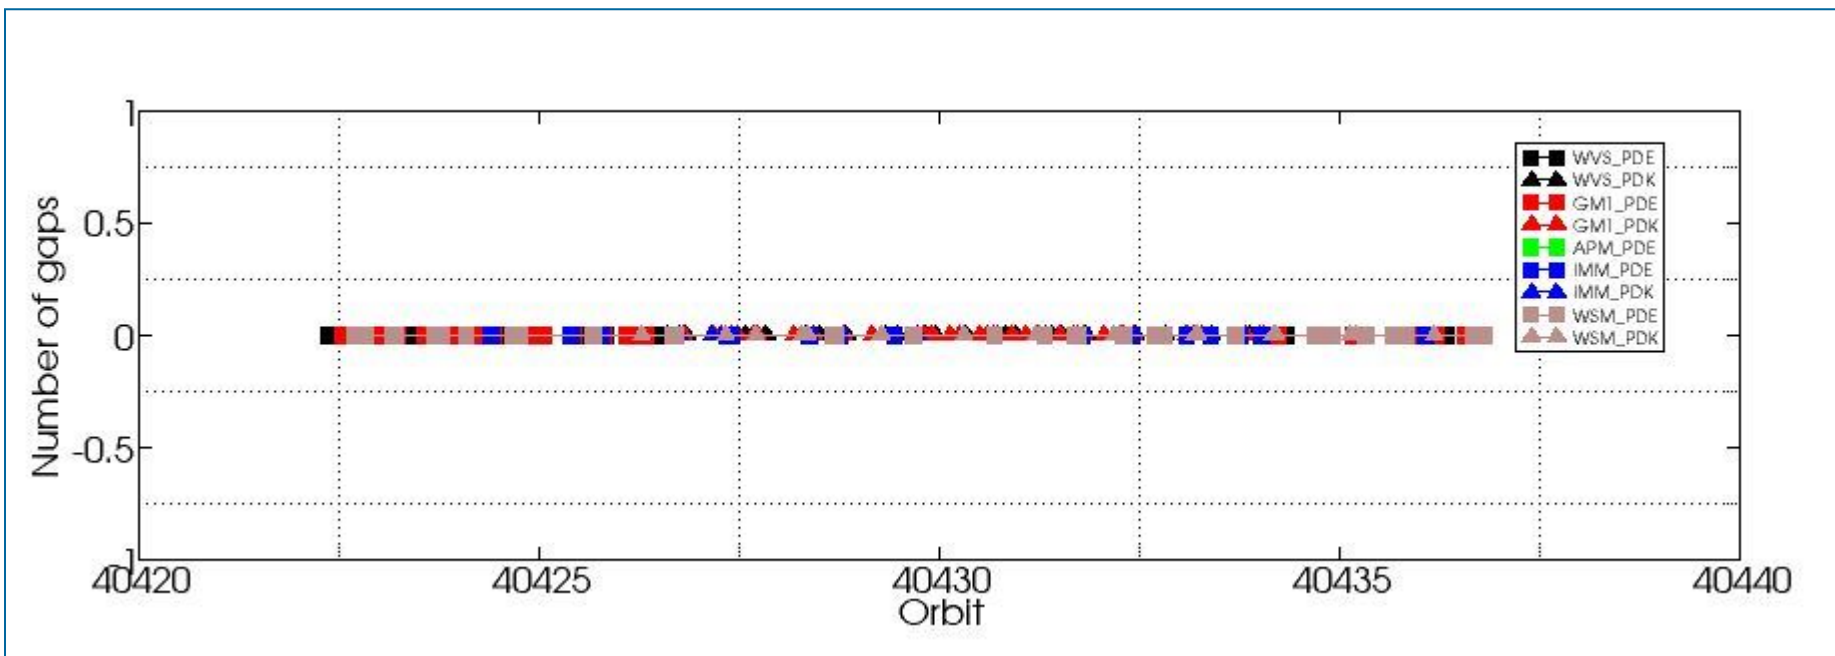

#####  
ASAR DAILY REPORT for 091123  
#####

MODE: DAILY  
ANALYSIS: ALL  
DATE: 2009-11-23

Analysis will be performed from 2009-11-23 00:00:00 to 2009-11-23 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_091123/

DATA SUMMARY

#####  
Summary will be performed from 2009-11-23 00:00:00 to 2009-11-23 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_091123/DATA\_SUMMARY

Creating directory ./RESULTS/DAILY/\_091123/DATA\_SUMMARY...  
Writing file ./RESULTS/DAILY/\_091123/DATA\_SUMMARY/Data\_summary.html...

\*\*\*\*\*  
Getting WVS products list from 2009-11-23 00:00:00 to 2009-11-23 23:59:59...  
Writing file ./RESULTS/DAILY/\_091123/DATA\_SUMMARY/List\_WVS\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_091123/DATA\_SUMMARY/List\_WVS\_products\_used.txt...

\*\*\*\*\*  
Getting GM1 products list from 2009-11-23 00:00:00 to 2009-11-23 23:59:59...  
Writing file ./RESULTS/DAILY/\_091123/DATA\_SUMMARY/List\_GM1\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_091123/DATA\_SUMMARY/List\_GM1\_products\_used.txt...

\*\*\*\*\*  
Getting APM products list from 2009-11-23 00:00:00 to 2009-11-23 23:59:59...  
Writing file ./RESULTS/DAILY/\_091123/DATA\_SUMMARY/List\_APM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_091123/DATA\_SUMMARY/List\_APM\_products\_used.txt...

\*\*\*\*\*  
Getting IMM products list from 2009-11-23 00:00:00 to 2009-11-23 23:59:59...  
Writing file ./RESULTS/DAILY/\_091123/DATA\_SUMMARY/List\_IMM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_091123/DATA\_SUMMARY/List\_IMM\_products\_used.txt...

\*\*\*\*\*  
Getting WSM products list from 2009-11-23 00:00:00 to 2009-11-23 23:59:59...  
Writing file ./RESULTS/DAILY/\_091123/DATA\_SUMMARY/List\_WSM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_091123/DATA\_SUMMARY/List\_WSM\_products\_used.txt...

\*\*\*\*\*  
Getting MS products list from 2009-11-23 00:00:00 to 2009-11-23 23:59:59...  
Writing file ./RESULTS/DAILY/\_091123/DATA\_SUMMARY/List\_MS\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_091123/DATA\_SUMMARY/List\_MS\_products\_used.txt...

DATA SUMMARY completed  
#####

AUXILIARY FILES ANALYSIS

#####  
Analysis will be performed from 2009-11-23 00:00:00 to 2009-11-23 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_091123/AUXILIARY

Creating directory ./RESULTS/DAILY/\_091123/AUXILIARY...

\*\*\*\*\*  
Looking for the IECF operational ADFs list...

ADF filter 20091123\*current\_3\_IECF\_ADFs.txt  
Found list 20091123\_030001\_current\_3\_IECF\_ADFs.txt...  
Extracting ADFs...

ASA\_CON\_AXVIEC20081215\_141339\_20070204\_165113\_20091231\_000000  
ASA\_INS\_AXVIEC20090525\_114808\_20090428\_100000\_20091231\_235959  
ASA\_XCH\_AXVIEC20081215\_143642\_20020301\_000000\_20091231\_000000  
ASA\_XCA\_AXVIEC20090311\_104501\_20080801\_000000\_20091231\_235959

Writing file ./RESULTS/DAILY/\_091123/AUXILIARY/ASAR\_ADFs\_IECF\_List3.html...  
Writing file ./RESULTS/DAILY/\_091123/AUXILIARY/Auxiliary\_files\_summary.html...

\*\*\*\*\*

Analysing WVS products...

Writing file ./RESULTS/DAILY/\_091123/AUXILIARY/Check\_ADFs\_WVS.xls...  
Writing file ./RESULTS/DAILY/\_091123/AUXILIARY/Check\_ADFs\_WVS.txt...

ASA_WVS_1PNPDE20091123_001139_000003752084_00288_40422_1208.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_003534_000002842084_00288_40422_0391.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_003919_000004942084_00288_40422_5486.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_005104_000009592084_00288_40422_5484.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_013622_000006592084_00289_40423_5502.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_015048_000004652084_00289_40423_1223.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_021521_000001352084_00289_40423_5510.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_021651_000002852084_00289_40423_5509.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_023531_000002392084_00290_40424_5508.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_031901_000008242084_00290_40424_5505.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_033215_000002552084_00290_40424_1220.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_040023_000009442084_00290_40424_5543.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_041822_000000742084_00291_40425_1233.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_045951_000009142084_00291_40425_1245.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_051436_000002852084_00291_40425_0406.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_053633_000015442084_00291_40425_0413.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_064403_000006442084_00292_40426_5539.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_195216_000019792084_00300_40434_1251.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_204148_000002402084_00300_40434_0700.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_213236_000019942084_00301_40435_5538.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_222355_000002852084_00301_40435_1304.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_222755_000007192084_00301_40435_1307.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_224811_000005252084_00302_40436_1299.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_231314_000013042084_00302_40436_1327.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20091123_234111_000003152084_00302_40436_5537.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_065433_000002702084_00292_40426_6886.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_071709_000019042084_00292_40426_6893.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_083220_000005252084_00293_40427_6931.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_085745_000020242084_00293_40427_6942.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_100408_000009742084_00294_40428_6972.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_103821_000018442084_00294_40428_6979.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_112855_000006442084_00295_40429_7013.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_114205_000011692084_00295_40429_7018.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_121857_000004052084_00295_40429_7021.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_123030_000010212084_00295_40429_7026.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_130939_000008692084_00296_40430_7070.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_135933_000004202084_00296_40430_7073.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_141206_000005242084_00296_40430_7082.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_145556_000005842084_00297_40431_7112.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_150856_000008692084_00297_40431_7121.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_154009_000013342084_00297_40431_7128.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_164255_000012592084_00298_40432_7161.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_172036_000014092084_00298_40432_7170.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_181822_000015742084_00299_40433_7198.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_190121_000000602084_00299_40433_7203.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20091123_190453_000007642084_00299_40433_7210.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK



```
ASA_GM1_1PNPDK20091123_153008_000001692084_00297_40431_7118.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091123_153623_000002232084_00297_40431_7123.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091123_160304_000007252084_00298_40432_7125.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091123_162423_000001082084_00298_40432_7156.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091123_162748_000006102084_00298_40432_7158.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091123_163846_000002472084_00298_40432_7165.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091123_174442_000001082084_00299_40433_7163.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091123_174830_000004532084_00299_40433_7167.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091123_175449_000001202084_00299_40433_7193.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091123_180431_000007732084_00299_40433_7195.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091123_185958_000000782084_00299_40433_7205.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091123_191815_000001382084_00299_40433_7200.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20091123_192305_000007122084_00300_40434_7207.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

\*\*\*\*\*

Analysing APM products...

Writing file ./RESULTS/DAILY/\_091123/AUXILIARY/Check\_ADFs\_APM.xls...

Writing file ./RESULTS/DAILY/\_091123/AUXILIARY/Check\_ADFs\_APM.txt...

```
ASA_APM_1PNPDE20091123_153254_00000432084_00297_40431_0864.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

\*\*\*\*\*

Analysing IMM products...

Writing file ./RESULTS/DAILY/\_091123/AUXILIARY/Check\_ADFs\_IMM.xls...

Writing file ./RESULTS/DAILY/\_091123/AUXILIARY/Check\_ADFs\_IMM.txt...

```
ASA_IMM_1PNPDE20091123_002306_000003722084_00288_40422_0667.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_020335_000000922084_00289_40423_0918.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_031146_000002552084_00290_40424_1143.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_031250_000000592084_00290_40424_0880.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_031449_000000722084_00290_40424_0929.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_034647_000000922084_00290_40424_5597.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_045115_000000632084_00291_40425_1023.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_045115_000002582084_00291_40425_5595.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_045115_000002582084_00291_40425_5598.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_045517_000000152084_00291_40425_1031.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_052527_000000922084_00291_40425_5628.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_052631_000000282084_00291_40425_1001.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_052747_000001832084_00291_40425_1265.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_052747_000003762084_00291_40425_5660.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_053150_000001332084_00291_40425_1266.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_070540_000001622084_00292_40426_1057.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_080838_000000632084_00293_40427_0628.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_080838_000001532084_00293_40427_1037.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_081041_000000302084_00293_40427_0632.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_081606_000002592084_00293_40427_0772.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_081606_000002592084_00293_40427_1139.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_095222_000002422084_00294_40428_1263.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_095222_000003012084_00294_40428_0798.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_095222_000003022084_00294_40428_5599.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_102931_000000632084_00294_40428_1095.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_102931_000000922084_00294_40428_1145.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_103036_000002432084_00294_40428_5608.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_103140_000000592084_00294_40428_1125.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_103140_000001772084_00294_40428_0774.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_114016_000000632084_00295_40429_1253.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_114016_000001022084_00295_40429_0768.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_114016_000001032084_00295_40429_5651.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_153409_000000632084_00297_40431_0522.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_153409_000001222084_00297_40431_1344.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_163758_000000372084_00298_40432_0468.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20091123_163758_000000372084_00298_40432_0546.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```









```

ASA_WSM_1PNPDK20091123_211121_000003052084_00301_40435_7251.N1   ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091123_211926_000001702084_00301_40435_7249.N1   ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20091123_225755_000001902084_00302_40436_7259.N1   ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

```

```

AUXILIARY FILES ANALYSIS completed
#####

```

```

MODULE STEPPING ANALYSIS
#####
Analysis will be performed from 2009-11-23 00:00:00 to 2009-11-23 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_091123/MODULE_STEPPING

```

```

Creating directory ./RESULTS/DAILY/_091123/MODULE_STEPPING...
Creating directory ./RESULTS/DAILY/_091123/MODULE_STEPPING/FIRST_REFERENCE...
Creating directory ./RESULTS/DAILY/_091123/MODULE_STEPPING/SECOND_REFERENCE...
Creating directory ./RESULTS/DAILY/_091123/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...
Deleting old files...

```

```

*****
*****
Creating images comparing with second reference...

```

```

Exporting results to the directory ../../RESULTS/DAILY/_091123/MODULE_STEPPING/SECOND_REFERENCE...

```

```

Polarization: H
Reference product: ASA_MS__0PNPDK20050922_062651_00000152041_00034_18625_0041.N1
Test product: ASA_MS__0PNPDE20091123_015915_00000162084_00289_40423_0477.N1
  H
  H

```

```

../../RESULTS/DAILY/_091123/MODULE_STEPPING/SECOND_REFERENCE/TGH_20091123_015915-20050922_062651.png
../../RESULTS/DAILY/_091123/MODULE_STEPPING/SECOND_REFERENCE/TPH_20091123_015915-20050922_062651.png
../../RESULTS/DAILY/_091123/MODULE_STEPPING/SECOND_REFERENCE/RGH_20091123_015915-20050922_062651.png
../../RESULTS/DAILY/_091123/MODULE_STEPPING/SECOND_REFERENCE/RPH_20091123_015915-20050922_062651.png

```

```

Polarization: V
Reference product: ASA_MS__0PNPDK20050923_055514_00000152041_00048_18639_0042.N1
Test product: ASA_MS__0PNPDK20091123_084139_00000162084_00293_40427_0921.N1
  V
  V

```

```

../../RESULTS/DAILY/_091123/MODULE_STEPPING/SECOND_REFERENCE/TGV_20091123_084139-20050923_055514.png
../../RESULTS/DAILY/_091123/MODULE_STEPPING/SECOND_REFERENCE/TPV_20091123_084139-20050923_055514.png
../../RESULTS/DAILY/_091123/MODULE_STEPPING/SECOND_REFERENCE/RGV_20091123_084139-20050923_055514.png
../../RESULTS/DAILY/_091123/MODULE_STEPPING/SECOND_REFERENCE/RPV_20091123_084139-20050923_055514.png

```

```

*****
*****
Creating images comparing with previous product reference...

```

```

Exporting results to the directory ../../RESULTS/DAILY/_091123/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

```

```

Polarization: H
Reference product: ASA_MS__0PNPDE20091121_030229_00000162084_00261_40395_0475.N1
Test product: ASA_MS__0PNPDE20091123_015915_00000162084_00289_40423_0477.N1
  H
  H

```

```

../../RESULTS/DAILY/_091123/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGH_20091123_015915-20091121_030229.png
../../RESULTS/DAILY/_091123/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPH_20091123_015915-20091121_030229.png
../../RESULTS/DAILY/_091123/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGH_20091123_015915-20091121_030229.png
../../RESULTS/DAILY/_091123/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPH_20091123_015915-20091121_030229.png

```

```

Polarization: V
Reference product: ASA_MS__0PNPDE20091122_023052_00000162084_00275_40409_0476.N1
Test product: ASA_MS__0PNPDK20091123_084139_00000162084_00293_40427_0921.N1
  V

```

V

```
../RESULTS/DAILY/_091123/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGV_20091123_084139-20091122_023052.png
../RESULTS/DAILY/_091123/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPV_20091123_084139-20091122_023052.png
../RESULTS/DAILY/_091123/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGV_20091123_084139-20091122_023052.png
../RESULTS/DAILY/_091123/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPV_20091123_084139-20091122_023052.png
```

MODULE\_STEPPING ANALYSIS completed

#####

CALIBRATION PULSES ANALYSIS

#####

Creating directory ./RESULTS/DAILY/\_091123/CALIBRATION\_PULSES...

\*\*\*\*\*  
\*\*\*\*\*

ALL ROWS Analysis will be performed from 2009-11-23 00:00:00 to 2009-11-23 23:59:59

Analysing products WVS IS2 V/V

Writing image ../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Calibration\_pulses\_all\_rows\_WVS\_IS2\_VV.png...

Analysing products GM1 SS3 H/H

Writing image ../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Calibration\_pulses\_all\_rows\_GM1\_SS3\_HH.png...

\*\*\*\*\*  
\*\*\*\*\*

TEMPORAL EVOLUTION Analysis will be performed from 2009-11-23 00:00:00 to 2009-11-23 23:59:59

Analysing products WVS IS2 V/V

Getting calibration pulses data for WVS IS2 V/V from 2009-11-23 00:00:00 to 2009-11-23 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/\_091123/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2009-11-23\_1.dat...

Writing ../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_1.png...

Writing ../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2009-11-23 00:00:00 to 2009-11-23 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/\_091123/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2009-11-23\_2.dat...

Writing ../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_2.png...

Writing ../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2009-11-23 00:00:00 to 2009-11-23 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/\_091123/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2009-11-23\_3.dat...

Writing ../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_3.png...

Writing ../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2009-11-23 00:00:00 to 2009-11-23 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/\_091123/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2009-11-23\_4.dat...

Writing ../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_4.png...

Writing ../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_4.png...

Analysing products GM1 SS3 H/H

Getting calibration pulses data for GM1 SS3 H/H from 2009-11-23 00:00:00 to 2009-11-23 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/\_091123/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2009-11-23\_1.dat...

Writing ../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_1.png...

Writing ../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_1.png...

Getting calibration pulses data for GM1 SS3 H/H from 2009-11-23 00:00:00 to 2009-11-23 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/\_091123/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2009-11-23\_2.dat...

Writing ../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_2.png...

Writing ../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2009-11-23 00:00:00 to 2009-11-23 23:59:59. Rows: 3/7/11/15/19/23/27/31  
Writing file ./RESULTS/DAILY/\_091123/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2009-11-23\_3.dat...  
Writing ../../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_3.png...  
Writing ../../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2009-11-23 00:00:00 to 2009-11-23 23:59:59. Rows: 4/8/12/16/20/24/28/32  
Writing file ./RESULTS/DAILY/\_091123/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2009-11-23\_4.dat...  
Writing ../../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_4.png...  
Writing ../../RESULTS/DAILY/\_091123//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_4.png...

CALIBRATION PULSES ANALYSIS completed

#####

DOPPLER ANALYSIS

#####

Creating directory ./RESULTS/DAILY/\_091123/DOPPLER...

\*\*\*\*\*  
\*\*\*\*\*

DOPPLER ANX Analysis will be performed from 2009-11-23 00:00:00 to 2009-11-23 23:59:59

Analysing products WVS IS2 V/V

Getting doppler data for WVS IS2 V/V from 2009-11-23 00:00:00 to 2009-11-23 23:59:59...

Writing file ./RESULTS/DAILY/\_091123/DOPPLER/Doppler\_data\_WVS\_IS2\_VV\_2009-11-23.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/\_091123/DOPPLER/DOPPLER\_ANX\_WVS\_IS2\_VV.png...

Analysing products GM1 SS1 H/H

Getting doppler data for GM1 SS1 H/H from 2009-11-23 00:00:00 to 2009-11-23 23:59:59...

Writing file ./RESULTS/DAILY/\_091123/DOPPLER/Doppler\_data\_GM1\_SS1\_HH\_2009-11-23.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/\_091123/DOPPLER/DOPPLER\_ANX\_GM1\_SS1\_HH.png...

\*\*\*\*\*  
\*\*\*\*\*

DOPPLER JUMPS Analysis will be performed on WSM products from 2009-11-23 00:00:00 to 2009-11-23 23:59:59

Analysing by default products WSM

Getting doppler jumps data for WSM from 2009-11-23 00:00:00 to 2009-11-23 23:59:59...

Writing file ./RESULTS/DAILY/\_091123/DOPPLER/Doppler\_Jumps\_data\_WSM\_2009-11-23.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/\_091123/DOPPLER/DOPPLER\_JUMPS\_ANX\_WSM.png...

Writing file ../../RESULTS/DAILY/\_091123/DOPPLER/DOPPLER\_JUMPS\_Date\_WSM.png...

\*\*\*\*\*  
\*\*\*\*\*

DOPPLER MAP Analysis will be performed from 2009-11-23 00:00:00 to 2009-11-23 23:59:59

Analysing products WVS IS2 V/V

Loading predicted doppler values....

Phase: descending

Found data...

Computing mean error doppler estimated-predicted...

Mean error = -36.937232 Hz

Writing file ../../RESULTS/DAILY/\_091123//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_WVS\_IS2\_VV\_desc.jpg...

Writing file ../../RESULTS/DAILY/\_091123//DOPPLER/DOPPLER\_Absolute\_WVS\_IS2\_VV\_desc.jpg...

\*\*\*\*\*

```
Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -36.349409 Hz
Writing file ../../RESULTS/DAILY/_091123//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_asc.jpg...
Writing file ../../RESULTS/DAILY/_091123//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_asc.jpg...
```

\*\*\*\*\*

```
Analysing products GM1 SS1 H/H
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -22.622354 Hz
Writing file ../../RESULTS/DAILY/_091123//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_desc.jpg...
Writing file ../../RESULTS/DAILY/_091123//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_desc.jpg...
```

\*\*\*\*\*

```
Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -28.047073 Hz
Writing file ../../RESULTS/DAILY/_091123//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_asc.jpg...
Writing file ../../RESULTS/DAILY/_091123//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_asc.jpg...
```

\*\*\*\*\*

```
DOPPLER ANALYSIS completed
#####
```

```
CHIRP ANALYSIS
#####
Creating directory ./RESULTS/DAILY/_091123/CHIRP...
```

```
*****
*****
CHIRP Analysis will be performed from 2009-11-23 00:00:00 to 2009-11-23 23:59:59
```

```
Analysing products WSM SS1 H/H
*****
Getting ScaleFactor data for WSM SS1 H/H from 2009-11-23 00:00:00 to 2009-11-23 23:59:59...
Writing file ./RESULTS/DAILY/_091123/CHIRP/ScaleFactor_data_WSM_SS1_HH_2009-11-23.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/_091123/CHIRP/ScaleFactor_ANX_WSM_SS1_HH.png...
Writing file ../../RESULTS/DAILY/_091123/CHIRP/ScaleFactor_DATE_WSM_SS1_HH.png...
```

```
Analysing products WSM SS1 V/V
*****
Getting ScaleFactor data for WSM SS1 V/V from 2009-11-23 00:00:00 to 2009-11-23 23:59:59...
Writing file ./RESULTS/DAILY/_091123/CHIRP/ScaleFactor_data_WSM_SS1_VV_2009-11-23.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/_091123/CHIRP/ScaleFactor_ANX_WSM_SS1_VV.png...
Writing file ../../RESULTS/DAILY/_091123/CHIRP/ScaleFactor_DATE_WSM_SS1_VV.png...
```

```
CHIRP ANALYSIS completed
#####
```

RAW DATA ANALYSIS

#####  
Analysis will be performed from 2009-11-23 00:00:00 to 2009-11-23 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_091123/RAW\_DATA

Creating directory ./RESULTS/DAILY/\_091123/RAW\_DATA...

\*\*\*\*\*  
Getting raw data for WVS from 2009-11-23 00:00:00 to 2009-11-23 23:59:59...  
Writing file ./RESULTS/DAILY/\_091123/RAW\_DATA/Raw\_data\_WVS\_2009-11-23.dat...  
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/\_091123/RAW\_DATA/Raw\_data\_WVS\_input\_mean.png...  
Creating image ../../RESULTS/DAILY/\_091123/RAW\_DATA/Raw\_data\_WVS\_input\_stdev.png...  
Creating image ../../RESULTS/DAILY/\_091123/RAW\_DATA/Raw\_data\_WVS\_gain\_imbalance.png...

\*\*\*\*\*  
Getting raw data for IMM from 2009-11-23 00:00:00 to 2009-11-23 23:59:59...  
Writing file ./RESULTS/DAILY/\_091123/RAW\_DATA/Raw\_data\_IMM\_2009-11-23.dat...  
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/\_091123/RAW\_DATA/Raw\_data\_IMM\_input\_mean.png...  
Creating image ../../RESULTS/DAILY/\_091123/RAW\_DATA/Raw\_data\_IMM\_input\_stdev.png...  
Creating image ../../RESULTS/DAILY/\_091123/RAW\_DATA/Raw\_data\_IMM\_gain\_imbalance.png...

RAW DATA ANALYSIS completed  
#####

TELEMETRY ANALYSIS

#####  
Analysis will be performed from 2009-11-23 00:00:00 to 2009-11-23 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_091123/TELEMETRY

Creating directory ./RESULTS/DAILY/\_091123/TELEMETRY...

Looking for gaps and missing lines in WVS products...  
\*\*\*\*\*  
Checking 26 products from PDE...  
Checking 21 products from PDK...

Looking for gaps and missing lines in GM1 products...  
\*\*\*\*\*  
Checking 35 products from PDE...  
Checking 39 products from PDK...

Looking for gaps and missing lines in APM products...  
\*\*\*\*\*  
Checking 1 products from PDE...  
No products from PDK...

Looking for gaps and missing lines in IMM products...  
\*\*\*\*\*  
Checking 54 products from PDE...  
Checking 4 products from PDK...

Looking for gaps and missing lines in WSM products...  
\*\*\*\*\*  
Checking 90 products from PDE...  
Checking 18 products from PDK...

Creating graph of missing lines and gaps...  
\*\*\*\*\*



Creating image: ./RESULTS/DAILY/\_091123/TELEMETRY/TELEMETRY\_Missing\_lines.png...
Creating image: ./RESULTS/DAILY/\_091123/TELEMETRY/TELEMETRY\_Gaps.png...

TELEMETRY ANALYSIS completed
#####

BROWSE PRODUCTS ANALYSIS
#####
Analysis will be performed on 2009-11-23

\*\*\*\*\*
Scanning directory /nfs-store/ASAR\_Data//ASA\_GM\_BP...
Results will be exported to the directory: /nfs-store/ASAR\_Data//ASA\_GM\_BP/JPG/20091123/

ANALYSIS COMPLETED: 0 GM browse products to see...
\*\*\*\*\*

\*\*\*\*\*
Scanning directory /nfs-store/ASAR\_Data//ASA\_AP\_BP...
Results will be exported to the directory: /nfs-store/ASAR\_Data//ASA\_AP\_BP/JPG/20091123/

ANALYSIS COMPLETED: 0 AP browse products to see...
\*\*\*\*\*

\*\*\*\*\*
Scanning directory /nfs-store/ASAR\_Data//ASA\_IM\_BP...
Results will be exported to the directory: /nfs-store/ASAR\_Data//ASA\_IM\_BP/JPG/20091123/

ANALYSIS COMPLETED: 0 IM browse products to see...
\*\*\*\*\*

\*\*\*\*\*
Scanning directory /nfs-store/ASAR\_Data//ASA\_WS\_BP...
Results will be exported to the directory: /nfs-store/ASAR\_Data//ASA\_WS\_BP/JPG/20091123/

ANALYSIS COMPLETED: 0 WS browse products to see...
\*\*\*\*\*

BROWSE PRODUCTS ANALYSIS completed
#####

HTML REPORT generation
#####

Building file ./RESULTS/DAILY/\_091123/asarReport.html...
Building DATA SUMMARY section...
Building AUXILIARY FILES ANALYSIS section...
Building MODULE STEPPING ANALYSIS section...
Building CALIBRATION PULSES ANALYSIS section...
Building DOPPLER ANALYSIS section...
Building CHIRP ANALYSIS section...
Building RAW DATA ANALYSIS section...
Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed
#####







Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20091123_153254_000000432084_00297_40431_0864.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20091123_000441_000004162084_00288_40422_0383.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_001841_000000782084_00288_40422_0378.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_002151_000000782084_00288_40422_0393.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_004821_000001632084_00288_40422_0933.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_011507_000010452084_00289_40423_1007.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_014800_000001692084_00289_40423_0927.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_020518_000003022084_00289_40423_0931.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_021333_000001082084_00289_40423_0925.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_022220_000007912084_00289_40423_0959.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_024757_000003202084_00290_40424_0923.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_025404_000010622084_00290_40424_1083.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_031613_000001632084_00290_40424_0968.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_034336_000001932084_00290_40424_1035.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_035650_000002112084_00290_40424_1033.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_041651_000000902084_00291_40425_1053.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_042024_000018312084_00291_40425_1107.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_045545_000002412084_00291_40425_5487.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_053411_000001382084_00291_40425_5485.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_060308_000010572084_00292_40426_1169.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_061839_000001262084_00292_40426_0410.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_061839_000001262084_00292_40426_1093.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_062712_000010092084_00292_40426_0510.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_194309_000005432084_00300_40434_0677.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_194309_000005432084_00300_40434_1151.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_203018_000003022084_00300_40434_0702.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_203018_000003022084_00300_40434_1149.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_205020_000010752084_00300_40434_1193.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_211632_000001692084_00301_40435_1147.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_212224_000004532084_00301_40435_5490.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_221614_000001872084_00301_40435_1159.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_224037_000003982084_00302_40436_5489.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_230113_000007182084_00302_40436_1165.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_233542_000002232084_00302_40436_1157.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_233929_000000962084_00302_40436_5488.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20091123_233929_000000962084_00302_40436_5511.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_071403_000001872084_00292_40426_6888.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_075112_000006822084_00293_40427_6890.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_080131_000003082084_00293_40427_6922.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_081318_000000902084_00293_40427_6924.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_082035_000007002084_00293_40427_6926.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_084257_000000902084_00293_40427_6928.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_084603_000007002084_00293_40427_6933.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_093221_000005732084_00294_40428_6939.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_094612_000000782084_00294_40428_6967.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_095816_000003502084_00294_40428_6969.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_103450_000002112084_00294_40428_6974.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_110947_000007312084_00295_40429_6976.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_121607_000001692084_00295_40429_7015.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_122625_000002412084_00295_40429_7023.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_124811_000009122084_00296_40430_7028.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_130210_000002352084_00296_40430_7061.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_132453_000006522084_00296_40430_7063.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_133552_000003682084_00296_40430_7065.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_134328_000000722084_00296_40430_7067.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_134919_000006102084_00296_40430_7075.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_140718_000002832084_00296_40430_7077.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_142345_000007672084_00297_40431_7079.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_144008_000001142084_00297_40431_7107.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_145000_000003562084_00297_40431_7109.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_150619_000001572084_00297_40431_7114.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_152404_000000842084_00297_40431_7116.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_153008_000001692084_00297_40431_7118.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_153623_000002232084_00297_40431_7123.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_160304_000007252084_00298_40432_7125.N1					OK	OK	OK	OK

ASA_GM1_1PNPDK20091123_162423_000001082084_00298_40432_7156.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_162748_000006102084_00298_40432_7158.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_163846_000002472084_00298_40432_7165.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_174442_000001082084_00299_40433_7163.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_174830_000004532084_00299_40433_7167.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_175449_000001202084_00299_40433_7193.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_180431_000007732084_00299_40433_7195.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_185958_000000782084_00299_40433_7205.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_191815_000001382084_00299_40433_7200.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20091123_192305_000007122084_00300_40434_7207.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_IMM_1PNPDE20091123_002306_000003722084_00288_40422_0667.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_020335_00000922084_00289_40423_0918.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_031146_000002552084_00290_40424_1143.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_031250_00000592084_00290_40424_0880.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_031449_00000722084_00290_40424_0929.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_034647_00000922084_00290_40424_5597.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_045115_00000632084_00291_40425_1023.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_045115_000002582084_00291_40425_5595.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_045115_000002582084_00291_40425_5598.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_045517_00000152084_00291_40425_1031.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_052527_00000922084_00291_40425_5628.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_052631_00000282084_00291_40425_1001.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_052747_000001832084_00291_40425_1265.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_052747_000003762084_00291_40425_5660.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_053150_000001332084_00291_40425_1266.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_070540_000001622084_00292_40426_1057.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_080838_00000632084_00293_40427_0628.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_080838_000001532084_00293_40427_1037.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_081041_00000302084_00293_40427_0632.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_081606_000002592084_00293_40427_0772.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_081606_000002592084_00293_40427_1139.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_095222_000002422084_00294_40428_1263.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_095222_000003012084_00294_40428_0798.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_095222_000003022084_00294_40428_5599.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_102931_00000632084_00294_40428_1095.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_102931_00000922084_00294_40428_1145.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_103036_000002432084_00294_40428_5608.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_103140_00000592084_00294_40428_1125.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_103140_000001772084_00294_40428_0774.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_114016_00000632084_00295_40429_1253.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_114016_000001022084_00295_40429_0768.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_114016_000001032084_00295_40429_5651.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_153409_00000632084_00297_40431_0522.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_153409_000001222084_00297_40431_1344.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_163758_00000372084_00298_40432_0468.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_163758_00000372084_00298_40432_0546.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_171139_00000632084_00298_40432_0526.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_171139_00000902084_00298_40432_0733.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_171359_000001612084_00298_40432_0725.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_171359_000001612084_00298_40432_1436.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_174627_000001142084_00299_40433_0681.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_181723_00000532084_00299_40433_5627.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_185144_00000902084_00299_40433_1346.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_185404_000003442084_00299_40433_5663.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_192032_000001422084_00300_40434_5500.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_192136_00000592084_00300_40434_1356.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_203519_000001232084_00300_40434_1454.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_203519_000001922084_00300_40434_5664.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_221025_00000912084_00301_40435_1293.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_221245_000001992084_00301_40435_1372.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_224712_00000532084_00302_40436_1360.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_235023_000001232084_00302_40436_1428.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_235023_000004432084_00302_40436_5494.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20091123_235327_00000592084_00302_40436_1414.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20091123_070910_000002832084_00292_40426_6918.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20091123_074931_00000892084_00293_40427_6916.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20091123_094730_00000372084_00294_40428_6944.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20091123_120817_000004592084_00295_40429_7057.N1					OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WSM_1PNPDE20091123_002004_000001042084_00288_40422_5594.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_003001_000001352084_00288_40422_0715.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_003001_000003362084_00288_40422_0756.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_003115_000000612084_00288_40422_0574.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_003311_000000612084_00288_40422_0450.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_003311_000000612084_00288_40422_0578.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_003513_000000242084_00288_40422_0454.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_010813_000002512084_00289_40423_0155.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_010813_000004092084_00289_40423_0396.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_011325_000000962084_00289_40423_0156.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_020106_000001352084_00289_40423_0113.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_021024_000001352084_00289_40423_0105.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_021024_000001832084_00289_40423_0201.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_024016_000002142084_00290_40424_0359.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_024130_000001152084_00290_40424_0159.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_033900_000000732084_00290_40424_0083.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_033900_000002692084_00290_40424_0398.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_034210_000000782084_00290_40424_0231.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_034921_000003302084_00290_40424_0189.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_052007_000000732084_00291_40425_0119.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_052007_000002752084_00291_40425_0598.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_052222_000001162084_00291_40425_0217.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_065953_000001352084_00292_40426_0695.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_065953_000003302084_00292_40426_0535.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_070107_000002552084_00292_40426_0249.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_070404_000000782084_00292_40426_0696.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_102100_000002142084_00294_40428_0394.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_102315_000000792084_00294_40428_0836.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_102502_000000912084_00294_40428_0454.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_102615_000000182084_00294_40428_0109.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_102703_000000732084_00294_40428_0115.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_102703_000000912084_00294_40428_0416.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_102703_000000912084_00294_40428_0776.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_120222_000003542084_00295_40429_0570.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_120222_000003542084_00295_40429_0814.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_120336_000002382084_00295_40429_0414.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_134443_000002502084_00296_40430_0751.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_134556_000001962084_00296_40430_0782.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_144706_000001702084_00297_40431_0307.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_152532_000001342084_00297_40431_0317.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_152532_000002682084_00297_40431_0630.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_152841_000000782084_00297_40431_0690.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_152942_000000182084_00297_40431_0199.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_162613_000000922084_00298_40432_0489.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_162727_000000182084_00298_40432_0220.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_162727_000000182084_00298_40432_0472.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_162727_000000182084_00298_40432_0556.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_170525_000002502084_00298_40432_0683.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_170834_000001412084_00298_40432_0746.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_171037_000000182084_00298_40432_0496.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_171728_000001522084_00298_40432_0559.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_171841_000000612084_00298_40432_0253.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_171841_000000782084_00298_40432_0688.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_184531_000000732084_00299_40433_0289.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_184531_000003302084_00299_40433_0673.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_184942_000000782084_00299_40433_0602.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_202642_000000732084_00300_40434_0223.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_202642_000000732084_00300_40434_0309.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_202642_000002142084_00300_40434_0618.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_202642_000002142084_00300_40434_0724.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_202857_000000552084_00300_40434_0313.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_202857_000000792084_00300_40434_0484.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_203908_000001532084_00300_40434_0596.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_203908_000001532084_00300_40434_0826.N1					OK	OK	OK	OK


ASA_WSM_1PNPDE20091123_204123_000000182084_00300_40434_0305.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_204644_000002132084_00300_40434_0632.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_204644_000002132084_00300_40434_0677.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_204757_000001152084_00300_40434_0503.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_204858_000000552084_00300_40434_0331.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_213000_000000732084_00301_40435_0257.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_213000_000000732084_00301_40435_0321.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_213000_000001522084_00301_40435_0620.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_213000_000001522084_00301_40435_0736.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_213214_000000182084_00301_40435_0261.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_220633_000000732084_00301_40435_0335.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_220633_000001902084_00301_40435_0662.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_220633_000002142084_00301_40435_0675.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_220633_000002142084_00301_40435_0696.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_220848_000000792084_00301_40435_0636.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_221923_000000732084_00301_40435_0279.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_221923_000000732084_00301_40435_0345.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_221923_000002752084_00301_40435_0634.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_221923_000002752084_00301_40435_0664.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_222138_000000552084_00301_40435_0283.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_222233_000000842084_00301_40435_0600.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_222334_000000242084_00301_40435_0287.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_234715_000001832084_00302_40436_0658.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_234829_000000612084_00302_40436_0369.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_235827_000000912084_00302_40436_0660.N1	OK	OK	OK	OK
ASA_WSM_1PNPDE20091123_235940_000000182084_00302_40436_0357.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_062049_000003732084_00292_40426_7046.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_080641_000000972084_00293_40427_6920.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_084429_000000922084_00293_40427_6961.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_094157_000002512084_00294_40428_6965.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_094845_000001212084_00294_40428_6963.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_112201_000004152084_00295_40429_6998.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_130612_000001892084_00296_40430_7059.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_143640_000001892084_00297_40431_7103.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_144206_000002752084_00297_40431_7105.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_161513_000003112084_00298_40432_7152.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_162110_000001892084_00298_40432_7154.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_175653_000002132084_00299_40433_7189.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_180114_000001902084_00299_40433_7191.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_193501_000001342084_00300_40434_7229.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_193748_000003122084_00300_40434_7231.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_211121_000003052084_00301_40435_7251.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_211926_000001702084_00301_40435_7249.N1	OK	OK	OK	OK
ASA_WSM_1PNPDK20091123_225755_000001902084_00302_40436_7259.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.


Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20091123_001139_000003752084_00288_40422_1208.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_003534_000002842084_00288_40422_0391.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_003919_000004942084_00288_40422_5486.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_005104_000009592084_00288_40422_5484.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_013622_000006592084_00289_40423_5502.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_015048_000004652084_00289_40423_1223.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_021521_000001352084_00289_40423_5510.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_021651_000002852084_00289_40423_5509.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_023531_000002392084_00290_40424_5508.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_031901_000008242084_00290_40424_5505.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_033215_000002552084_00290_40424_1220.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_040023_000009442084_00290_40424_5543.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_041822_000000742084_00291_40425_1233.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_045951_000009142084_00291_40425_1245.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_051436_000002852084_00291_40425_0406.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_053633_000015442084_00291_40425_0413.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_064403_000006442084_00292_40426_5539.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_195216_000019792084_00300_40434_1251.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_204148_000002402084_00300_40434_0700.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_213236_000019942084_00301_40435_5538.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_222355_000002852084_00301_40435_1304.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_222755_000007192084_00301_40435_1307.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_224811_000005252084_00302_40436_1299.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_231314_000013042084_00302_40436_1327.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20091123_234111_000003152084_00302_40436_5537.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_065433_000002702084_00292_40426_6886.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_071709_000019042084_00292_40426_6893.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_083220_000005252084_00293_40427_6931.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_085745_000020242084_00293_40427_6942.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_100408_000009742084_00294_40428_6972.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_103821_000018442084_00294_40428_6979.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_112855_000006442084_00295_40429_7013.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_114205_000011692084_00295_40429_7018.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_121857_000004052084_00295_40429_7021.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_123030_000010212084_00295_40429_7026.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_130939_000008692084_00296_40430_7070.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_135933_000004202084_00296_40430_7073.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_141206_000005242084_00296_40430_7082.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_145556_000005842084_00297_40431_7112.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_150856_000008692084_00297_40431_7121.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_154009_000013342084_00297_40431_7128.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_164255_000012592084_00298_40432_7161.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_172036_000014092084_00298_40432_7170.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_181822_000015742084_00299_40433_7198.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_190121_000000602084_00299_40433_7203.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20091123_190453_000007642084_00299_40433_7210.N1					OK	OK	OK	OK




Calibration pulses for GM1 SS3 H/H

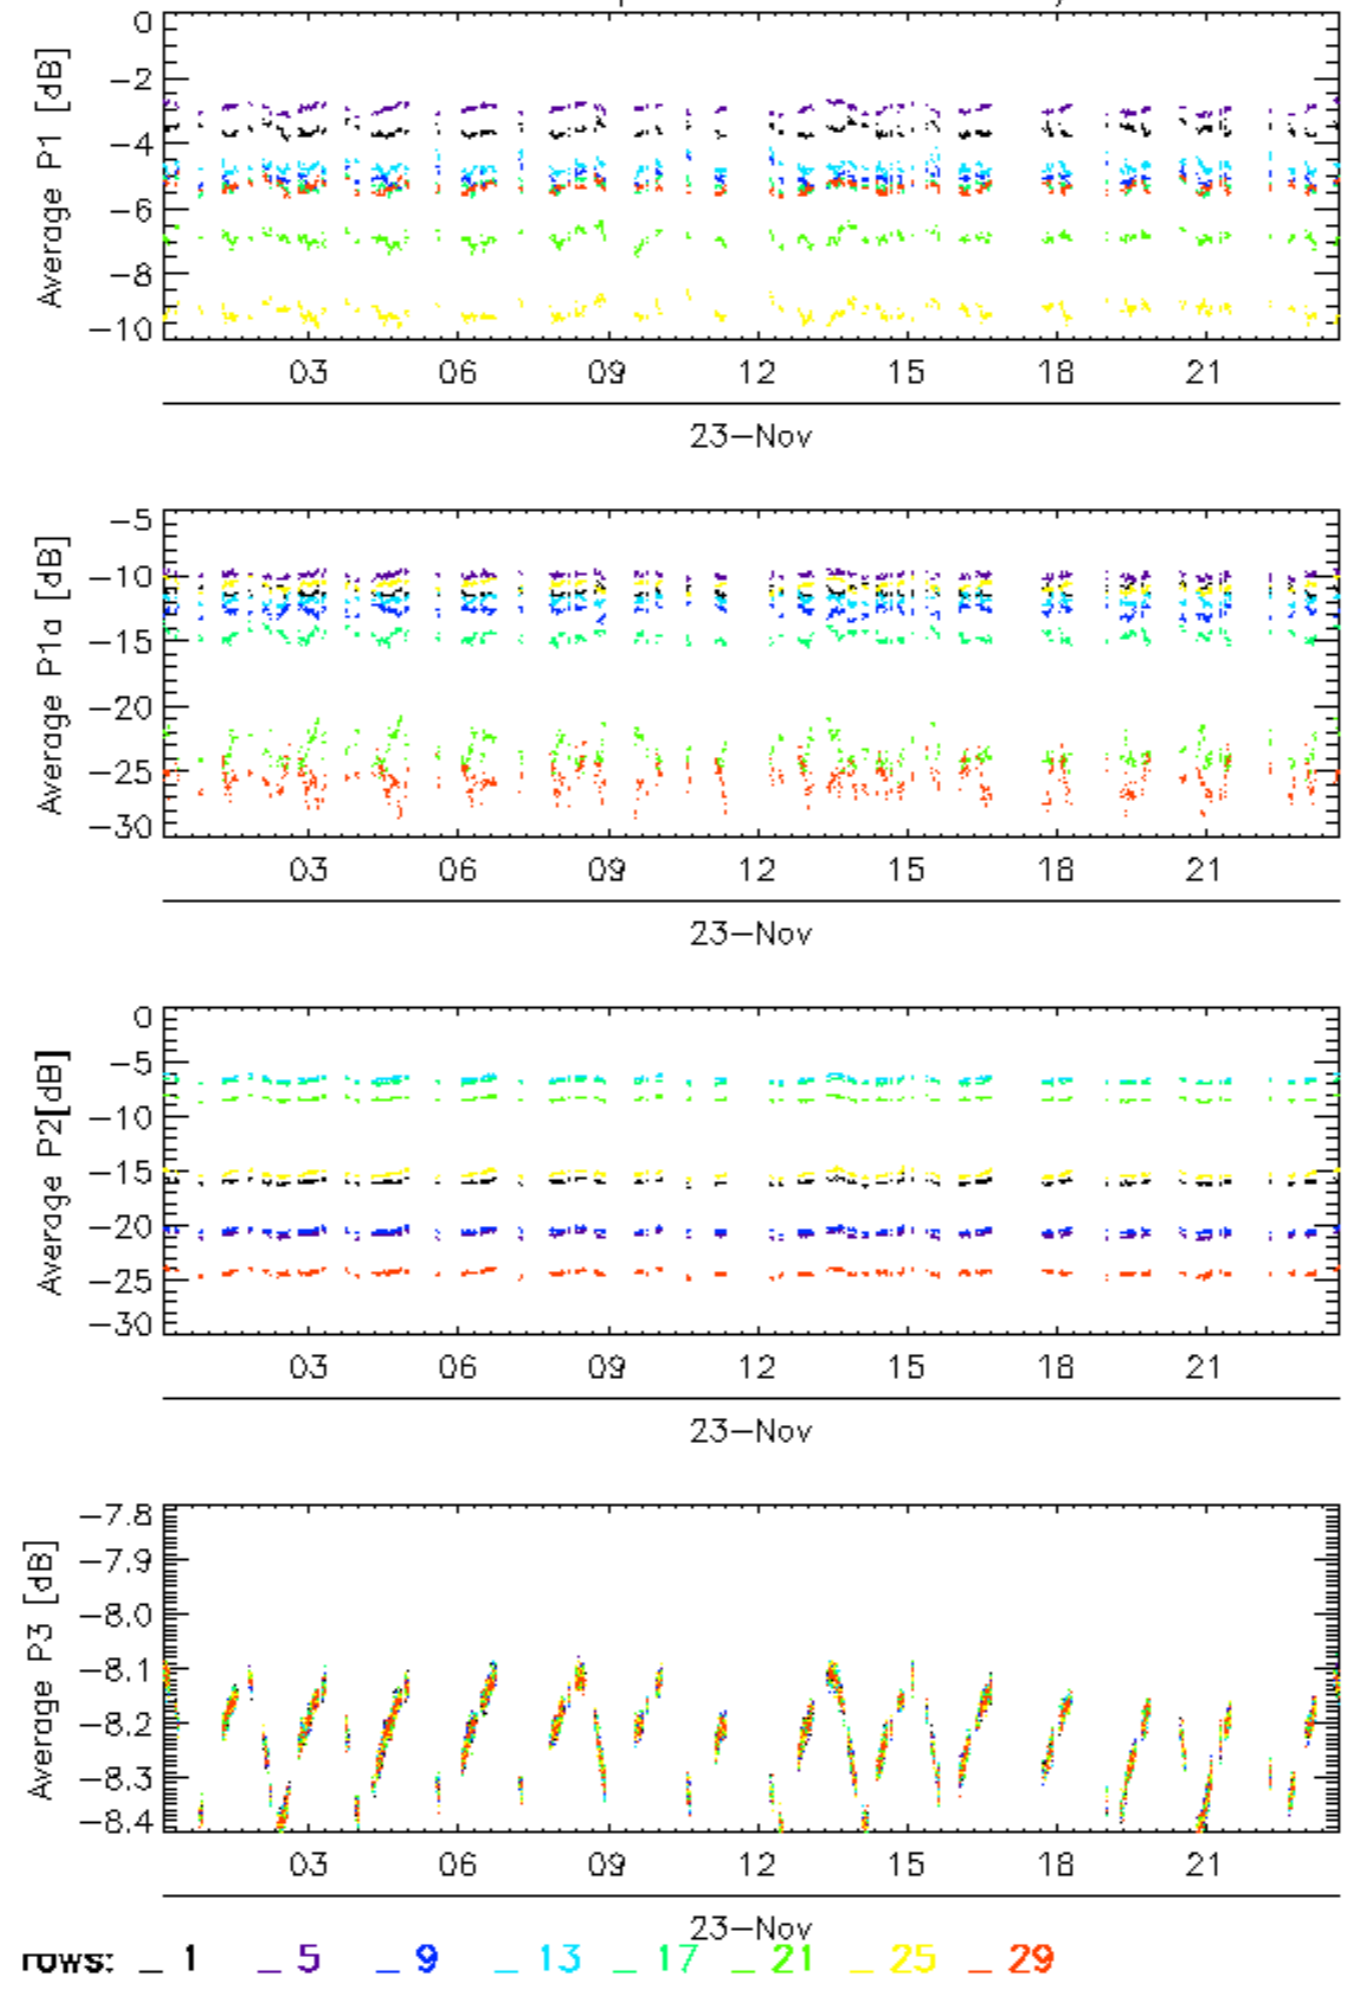


### Calibration pulses for GM1 SS3 H/H

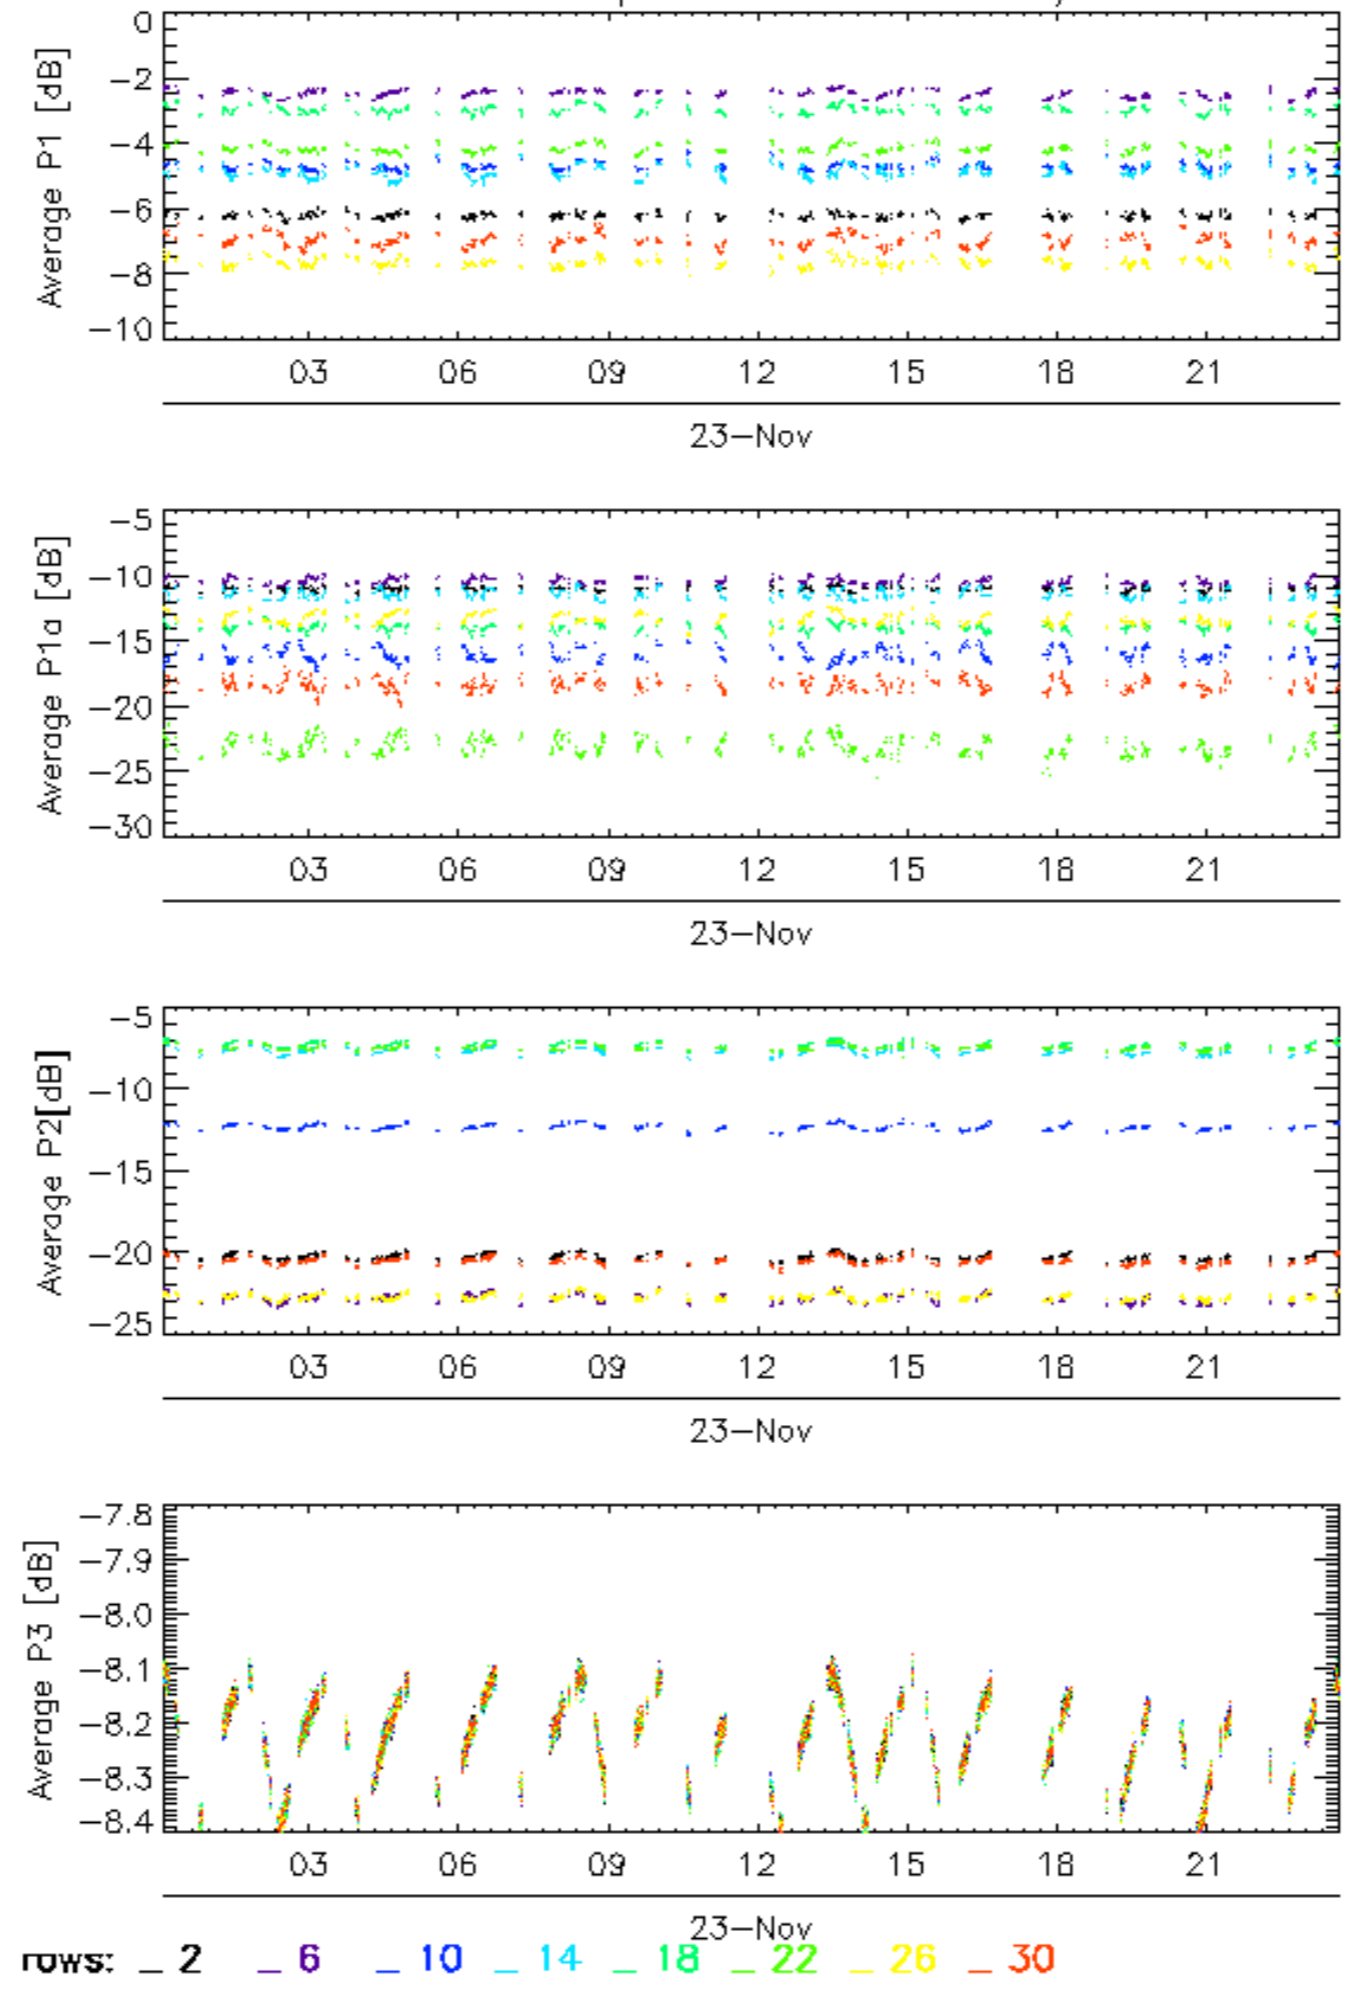


### Calibration pulses for GM1 SS3 H/H

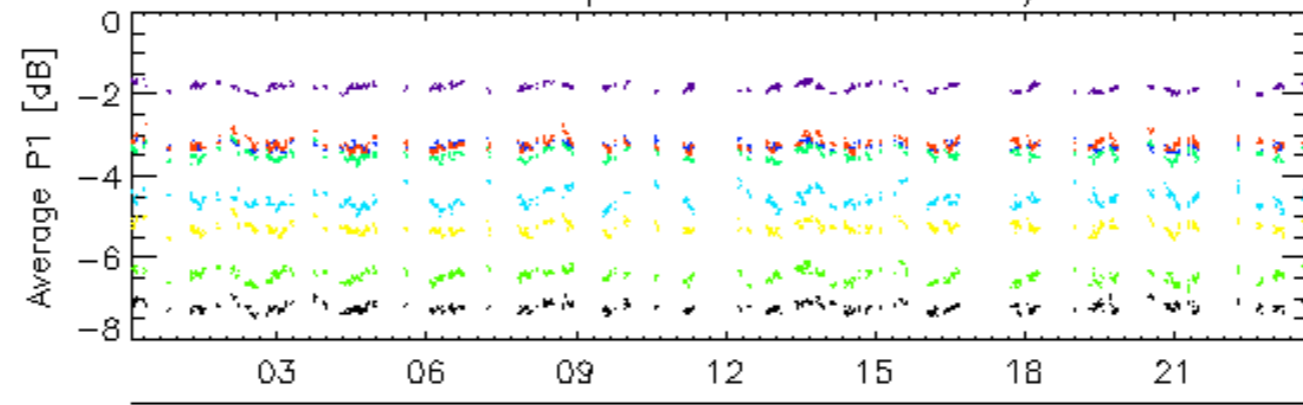


23-Nov

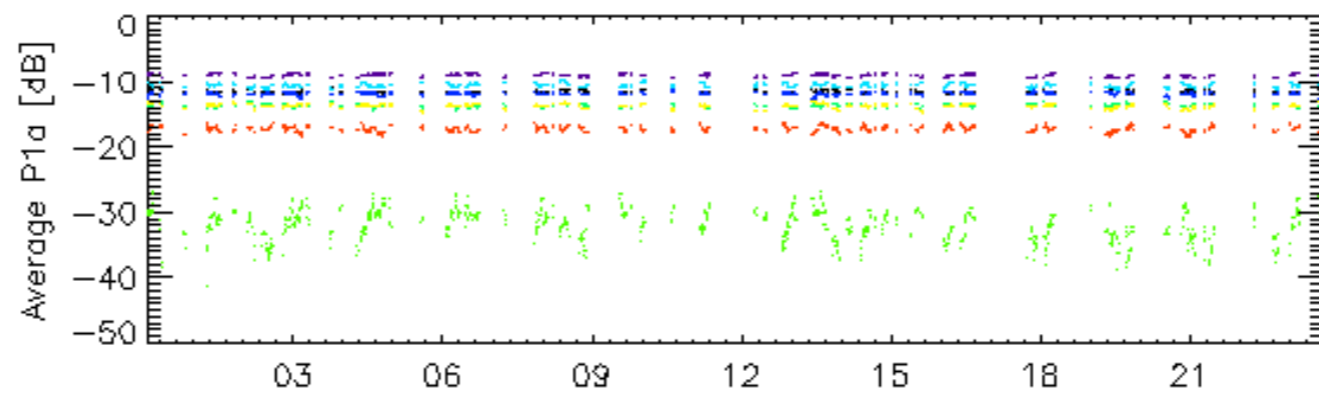

23-Nov

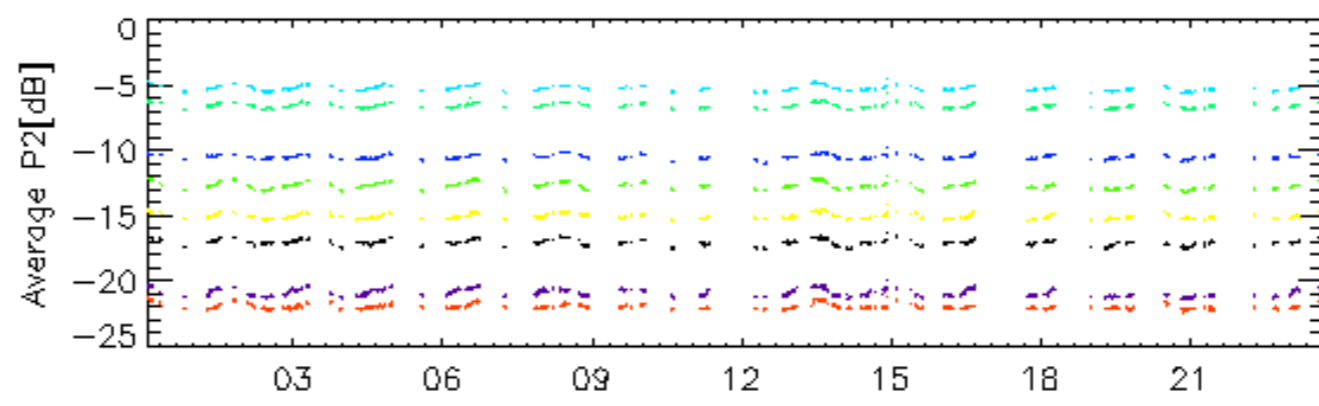


23-Nov

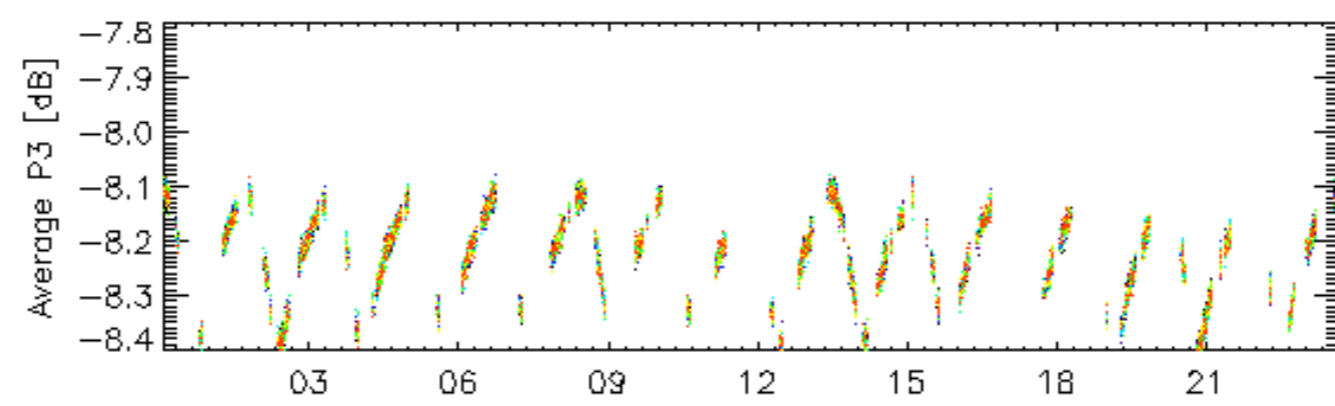


23-Nov

rows: \_ 3 \_ 7 \_ 11 \_ 15 \_ 19 **23** \_ 27 \_ 31


Calibration pulses for GM1 SS3 H/H

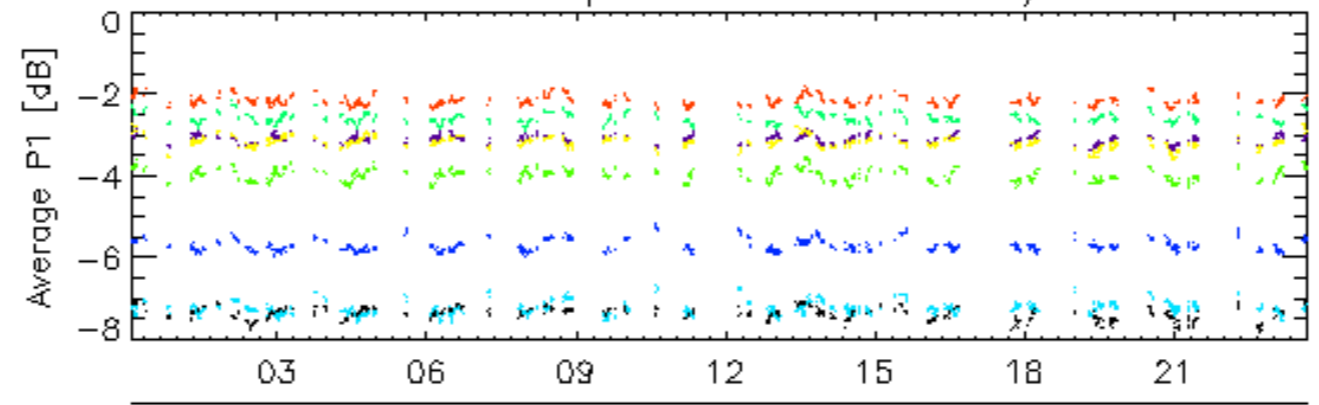


23-Nov

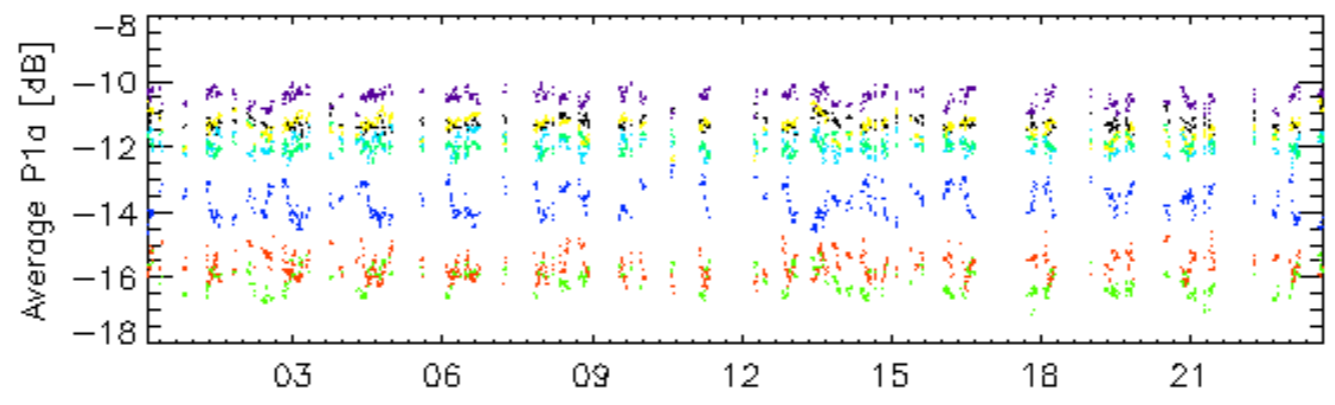

23-Nov

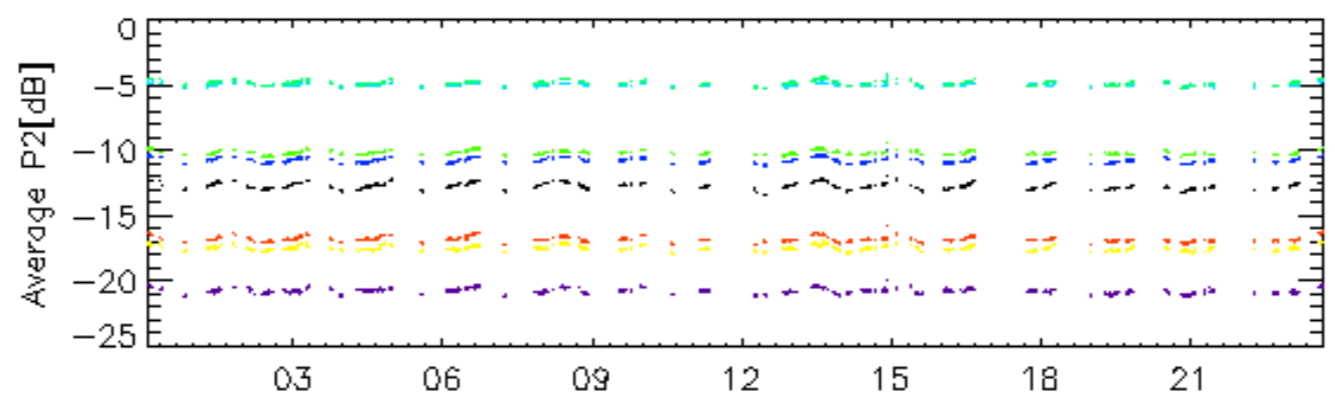


23-Nov

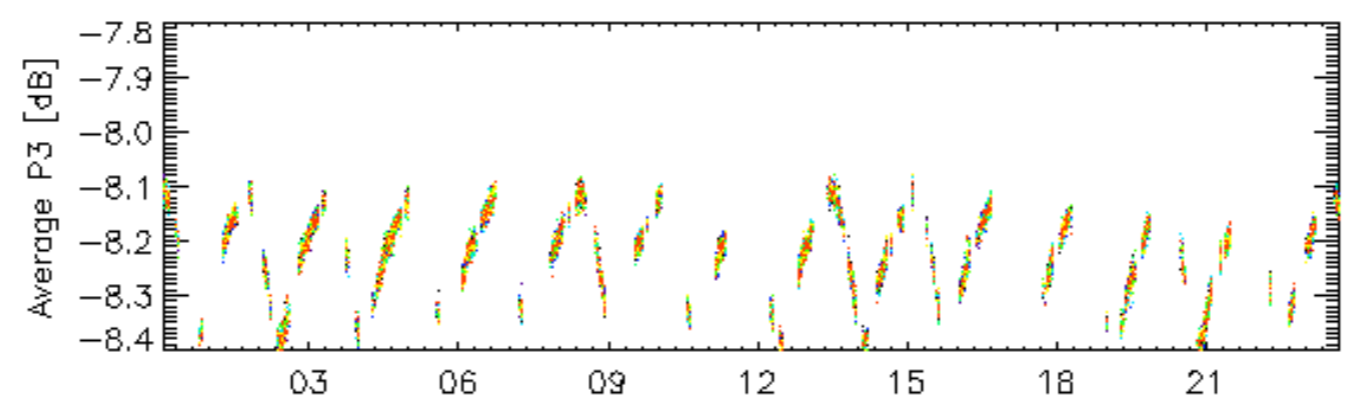


23-Nov

rows: \_ 4 \_ 8 \_ 12 \_ 16 \_ 20 <sup>23-Nov</sup> \_ 24 \_ 28 \_ 32


### Calibration pulses for WVS IS2 V/V

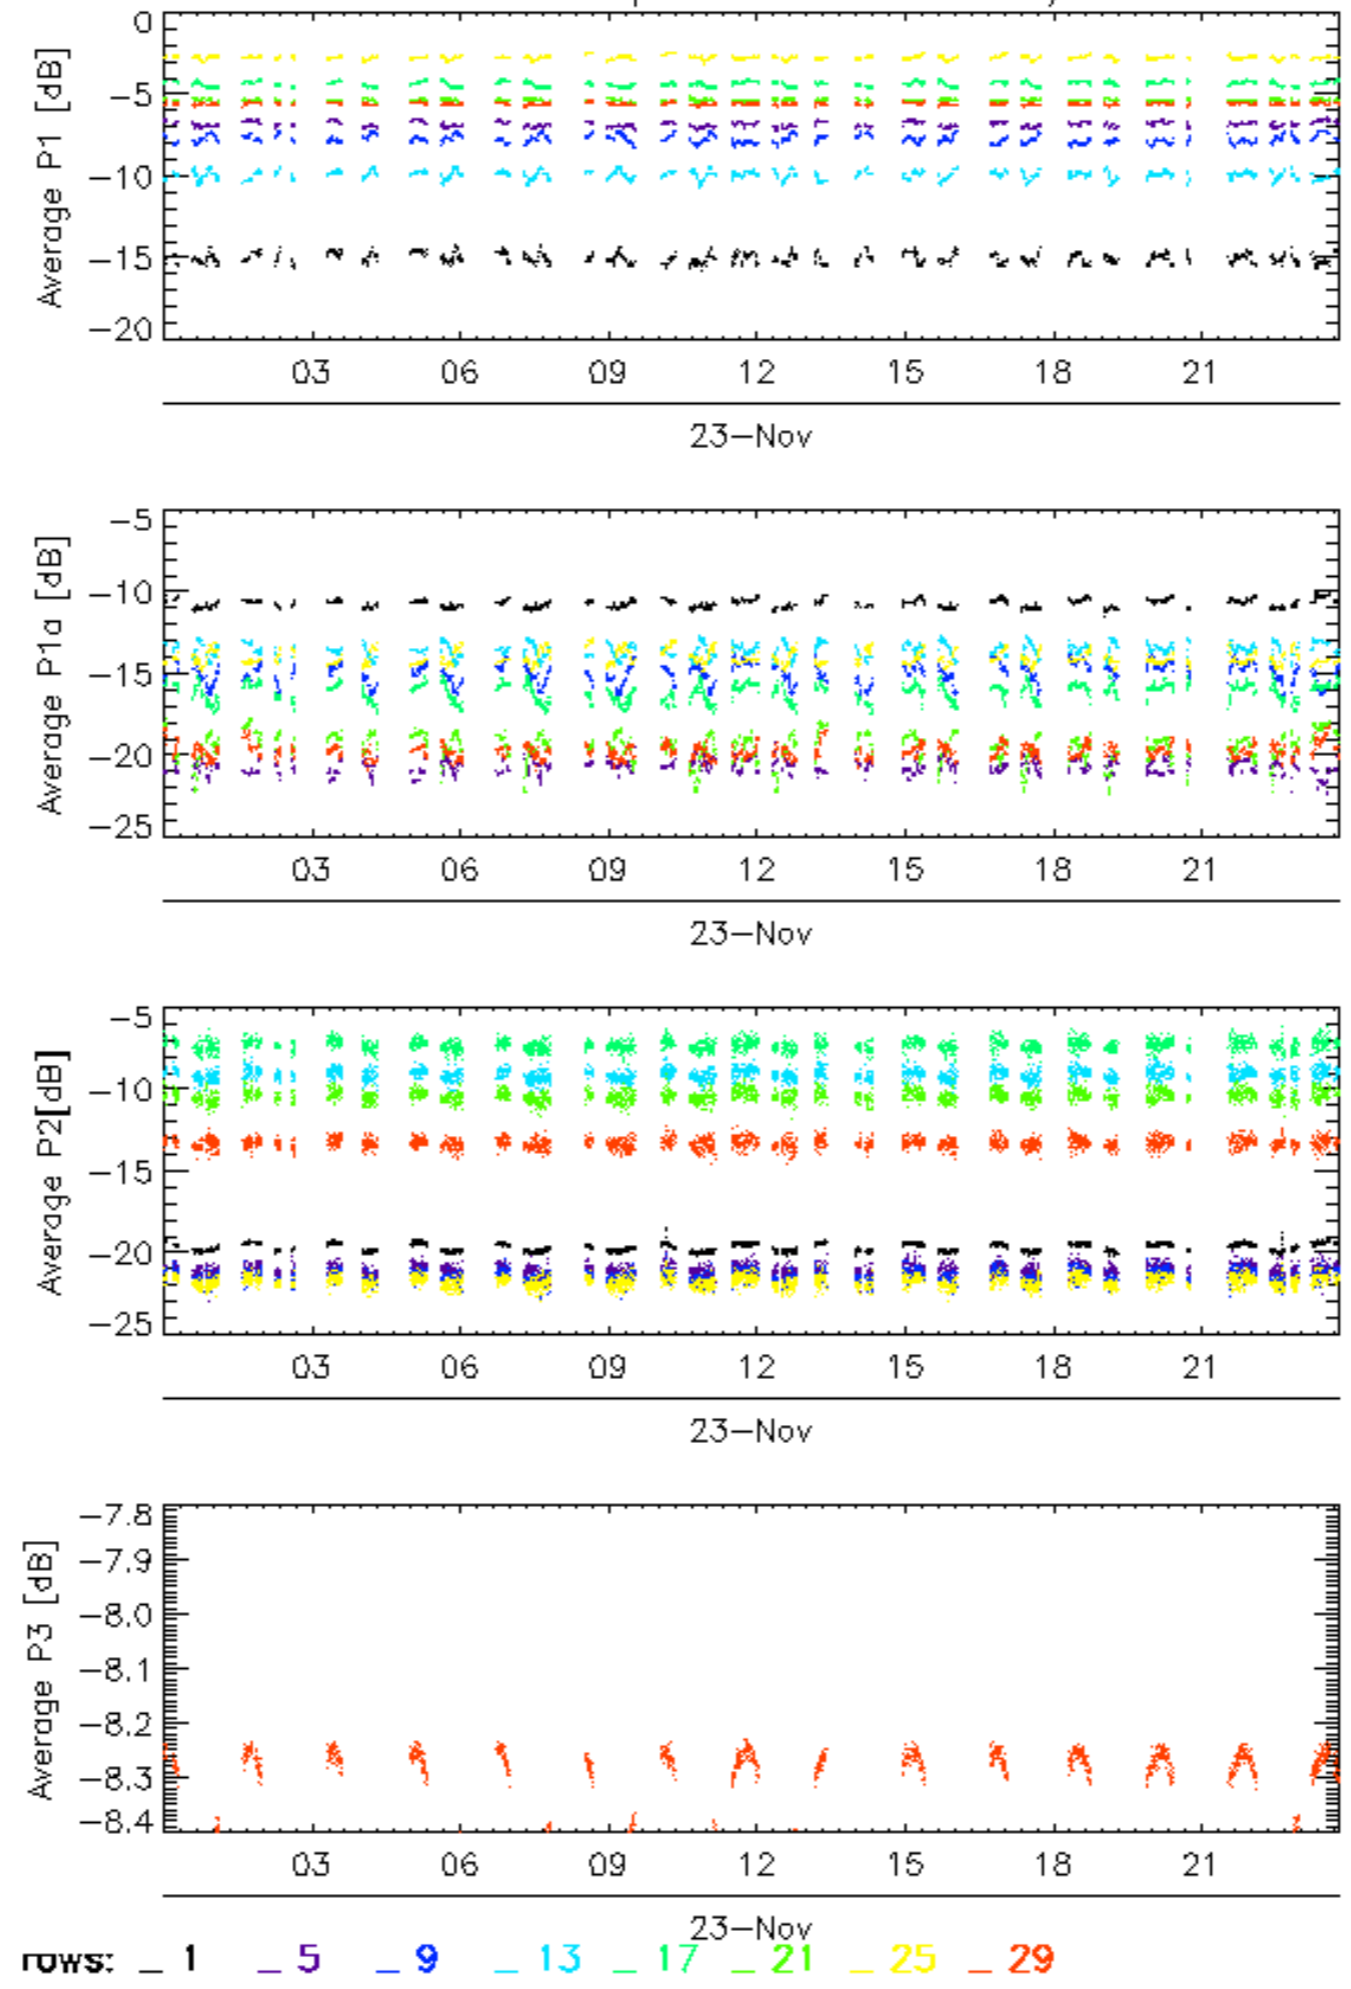


Calibration pulses for WVS IS2 V/V

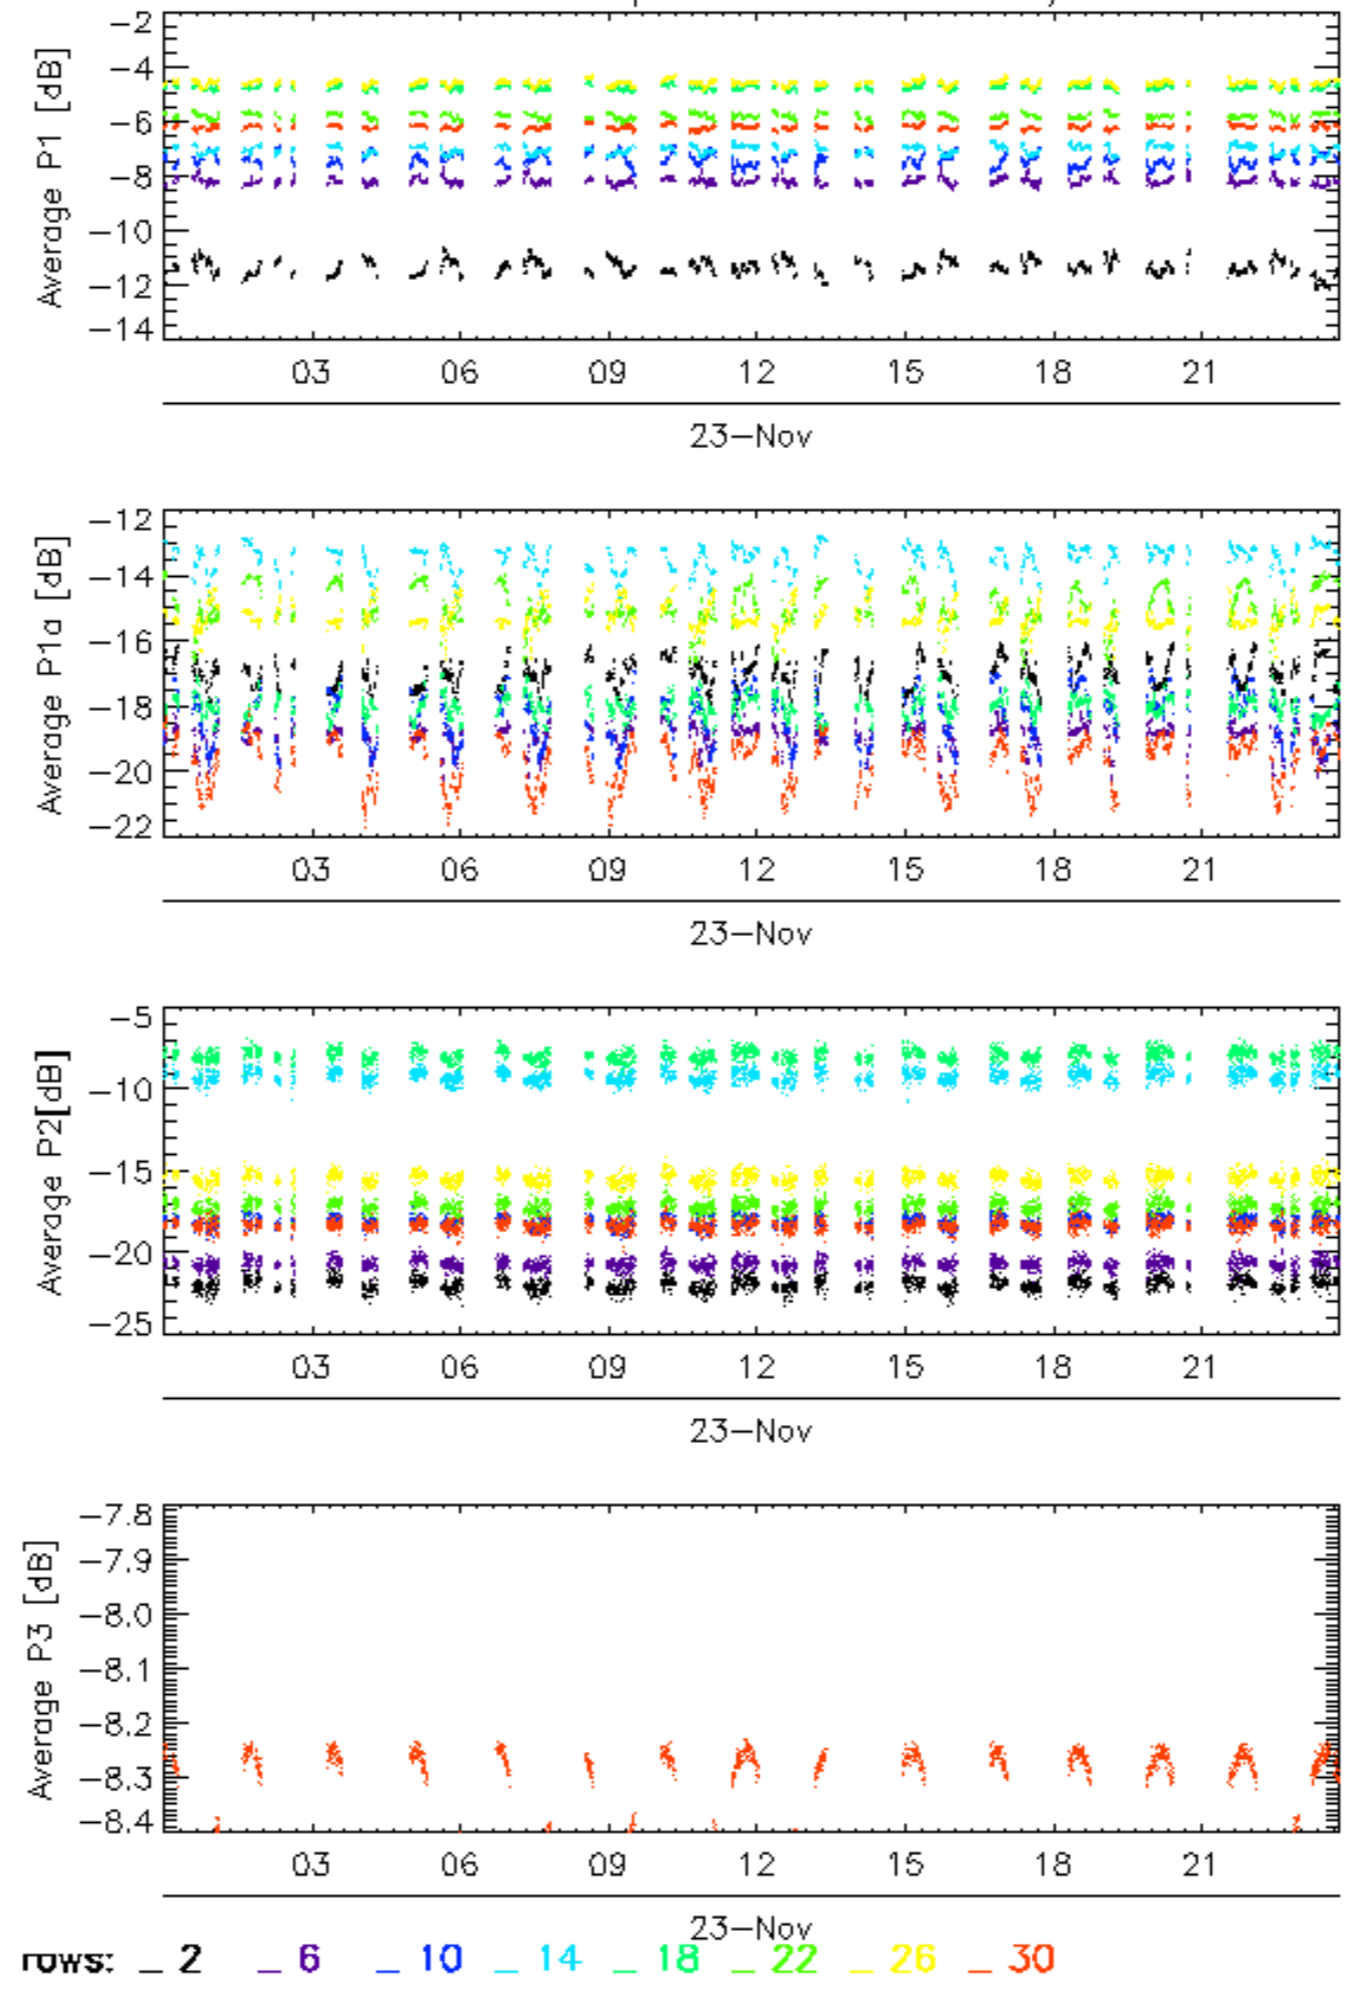


Calibration pulses for WVS IS2 V/V

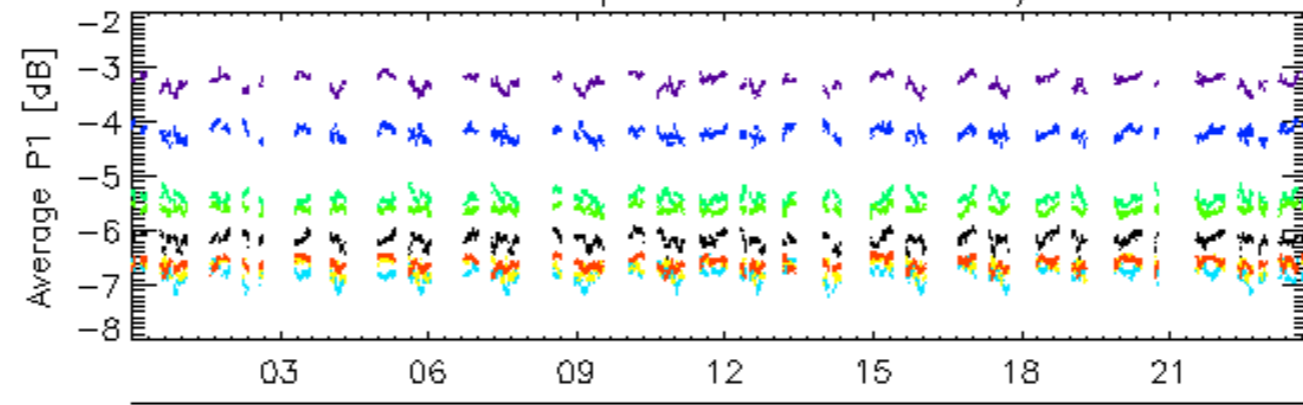


23-Nov

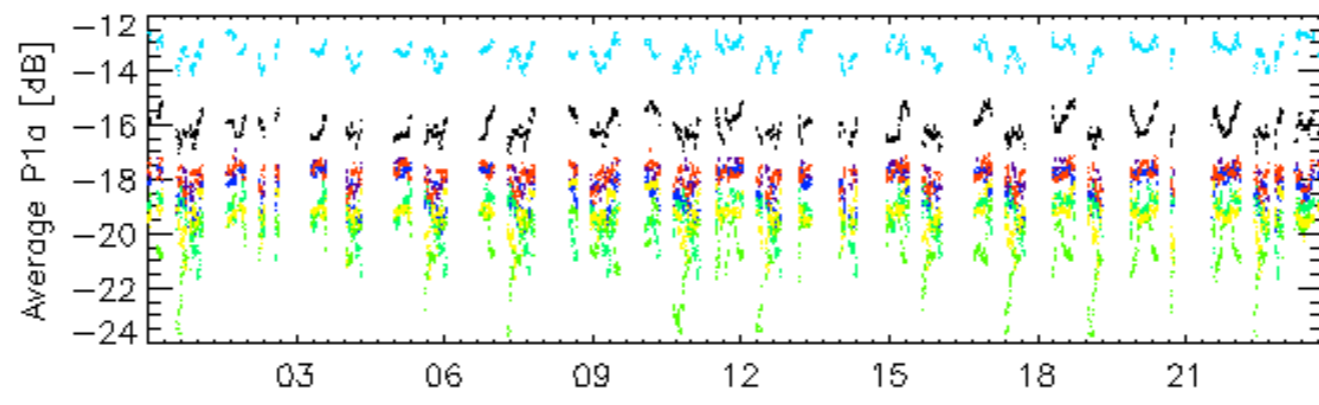

23-Nov

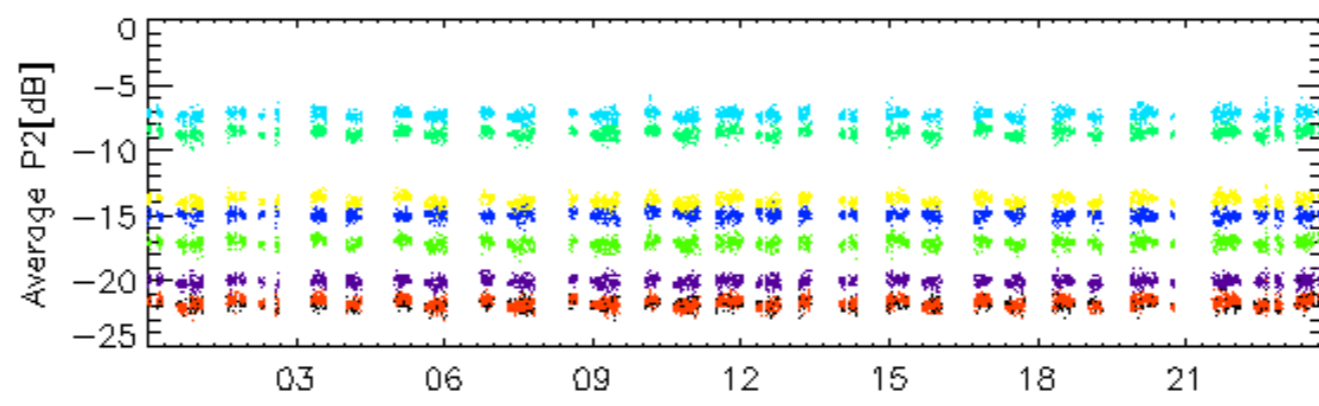


23-Nov

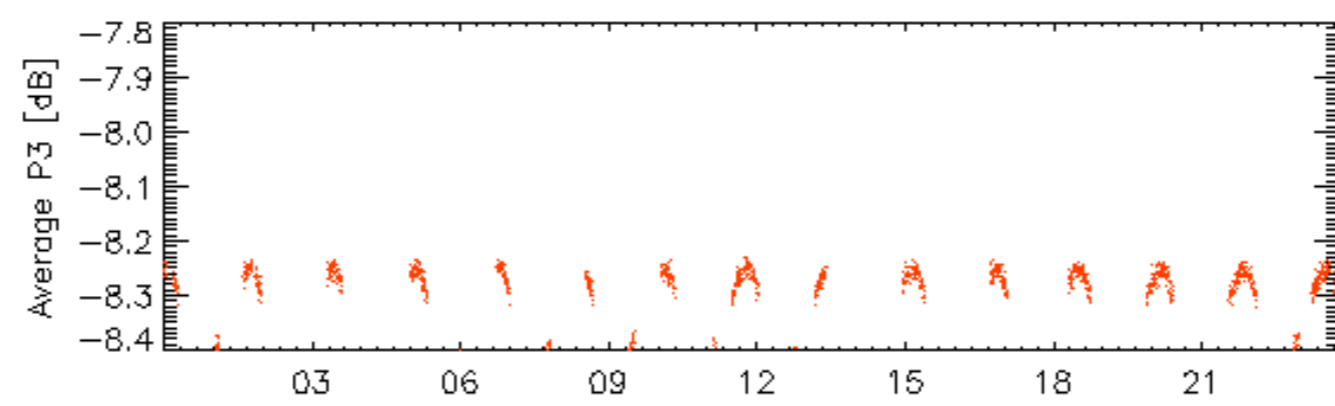


23-Nov

rows: \_ 3 \_ 7 \_ 11 \_ 15 \_ 19 \_ 23 \_ 27 \_ 31


### Calibration pulses for WVS IS2 V/V

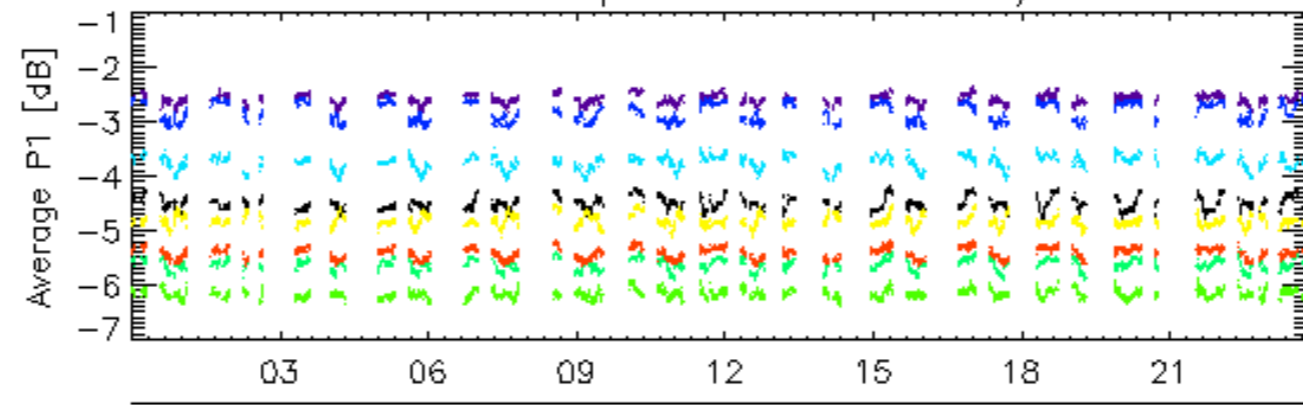


23-Nov

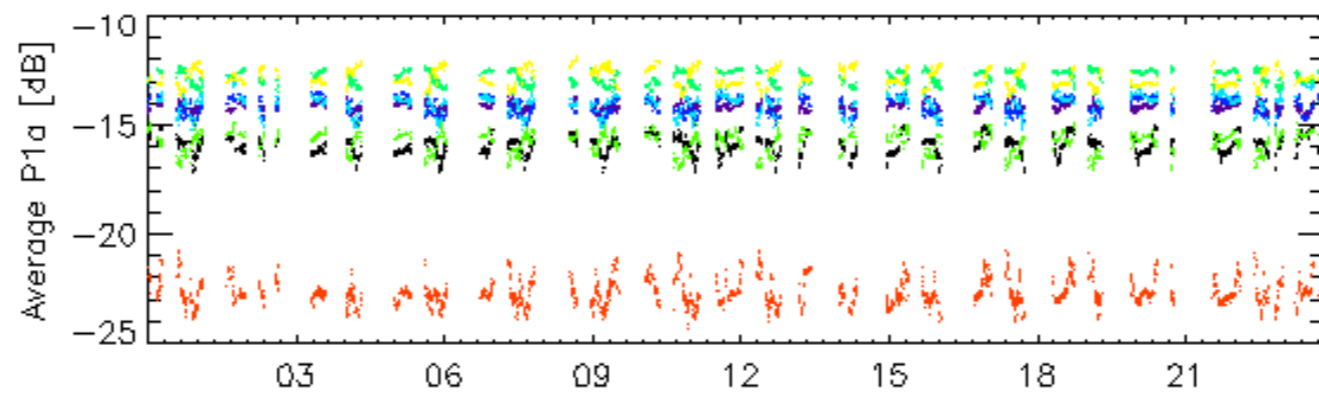

23-Nov

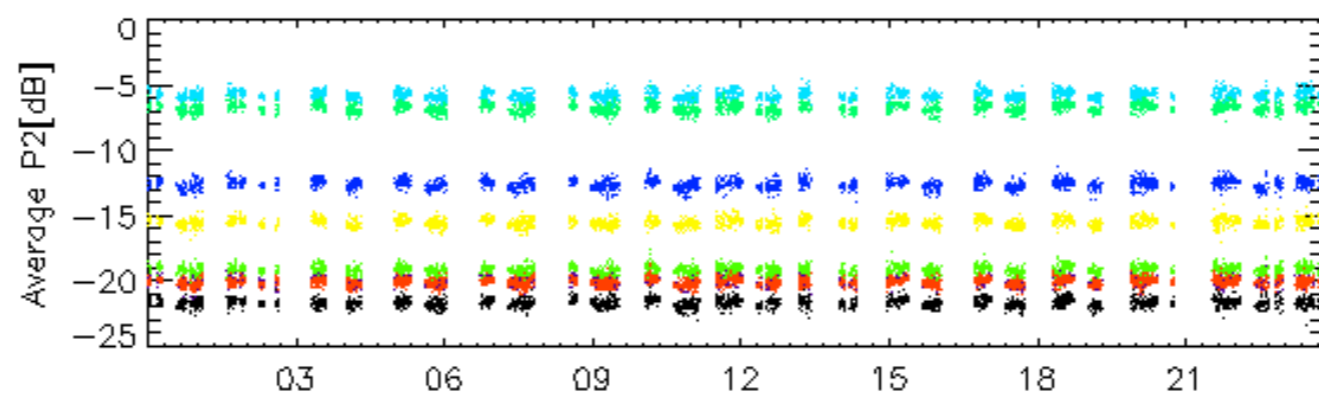


23-Nov

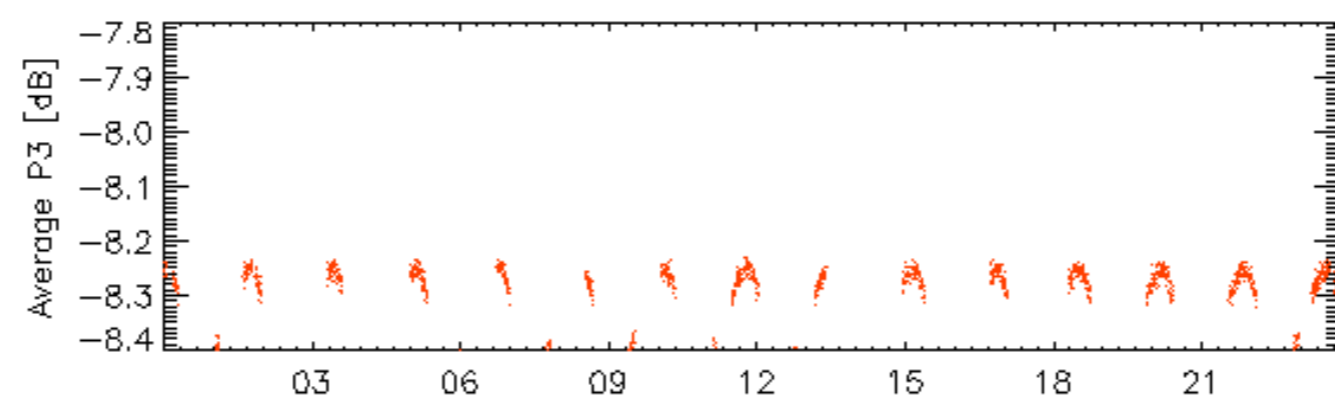




23-Nov

rows: \_ 4 \_ 8 \_ 12 \_ 16 \_ 20 <sup>23-Nov</sup> \_ 24 \_ 28 \_ 32





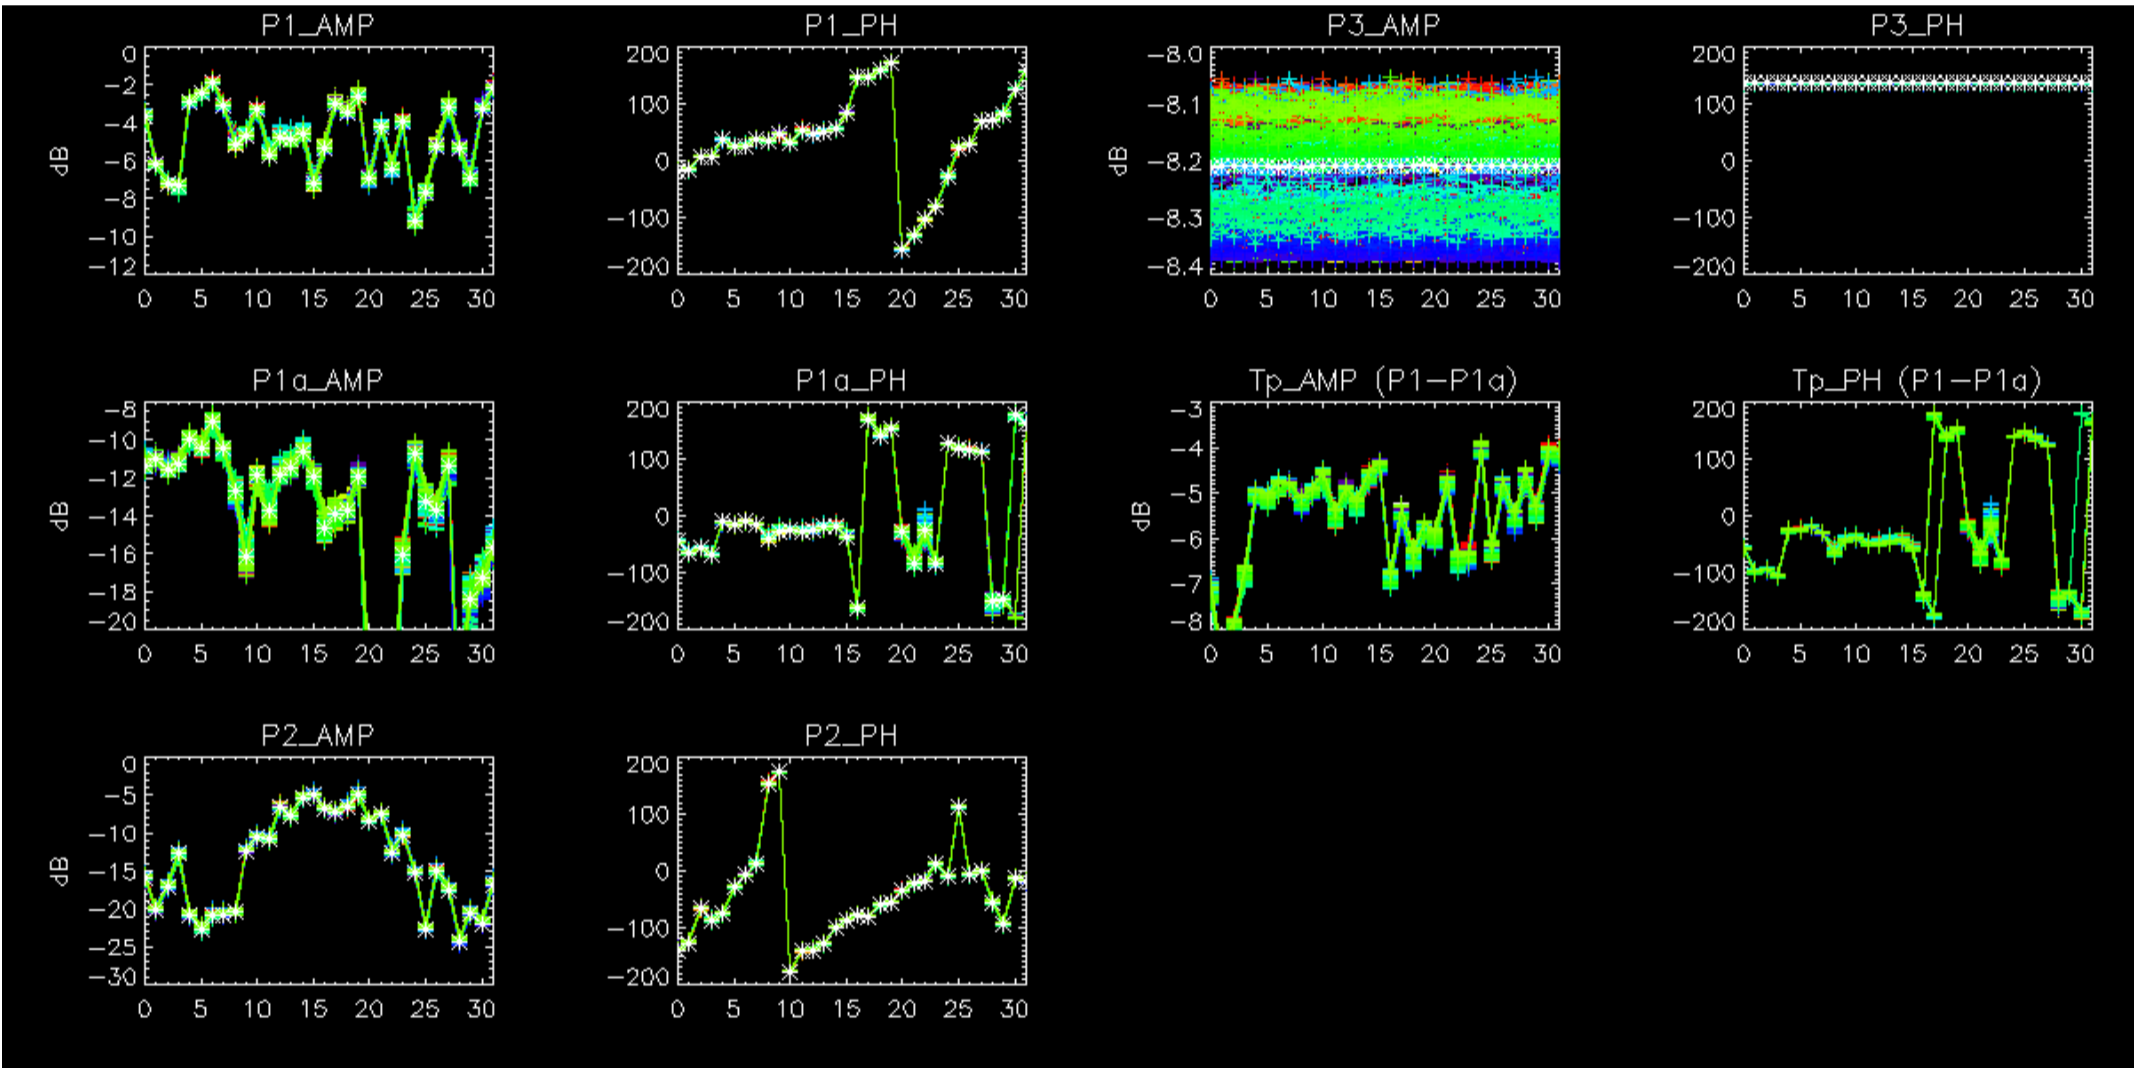


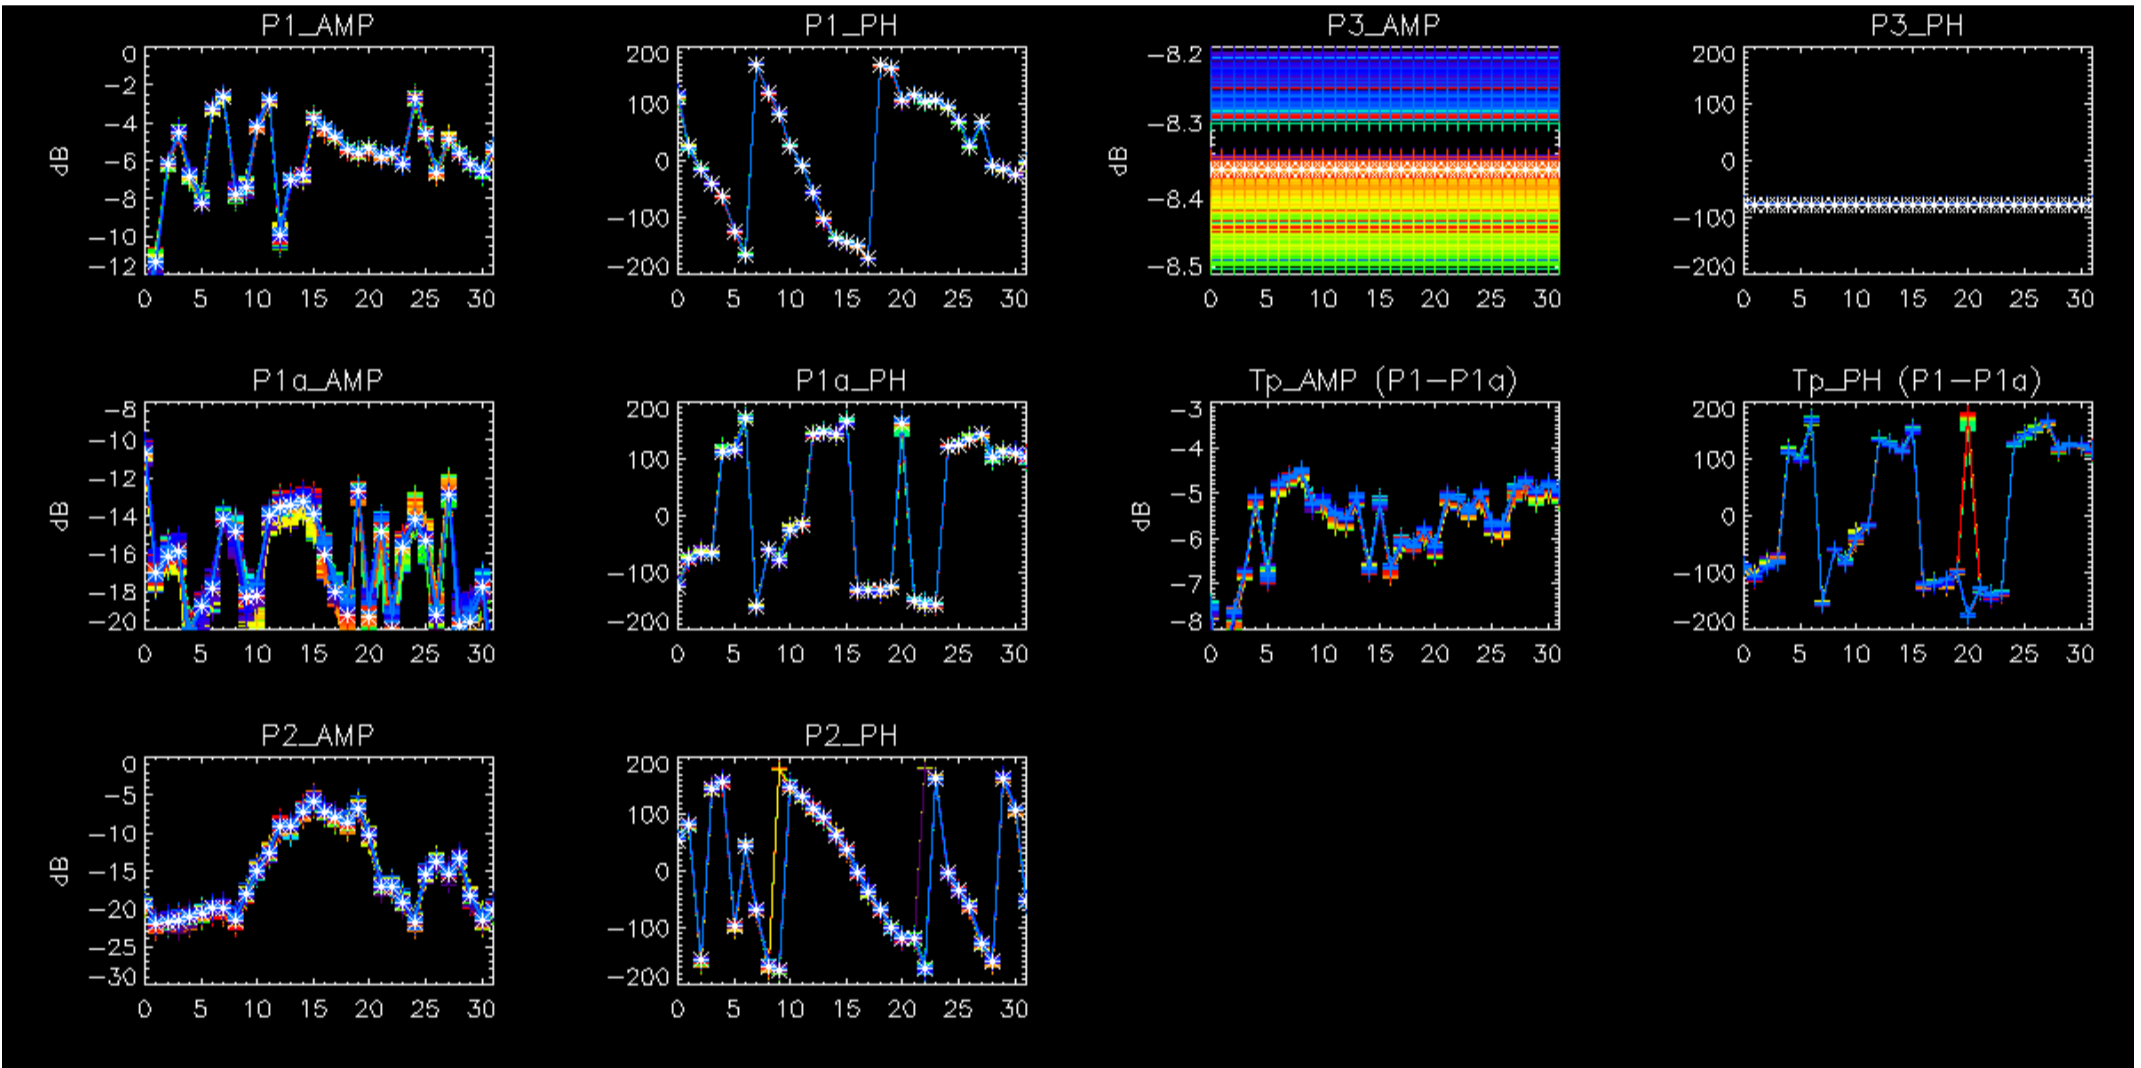


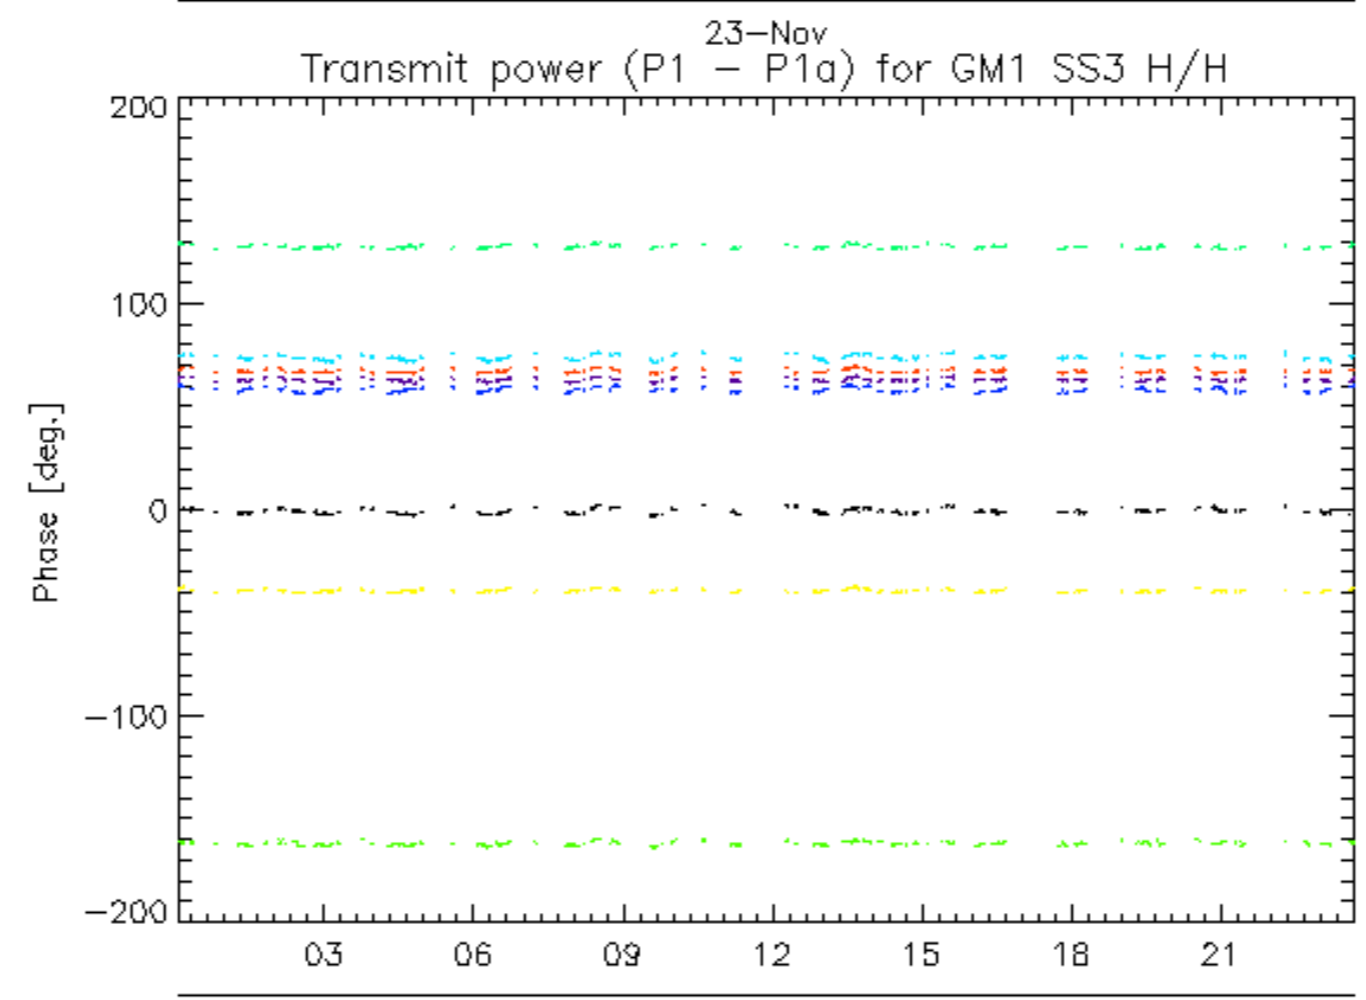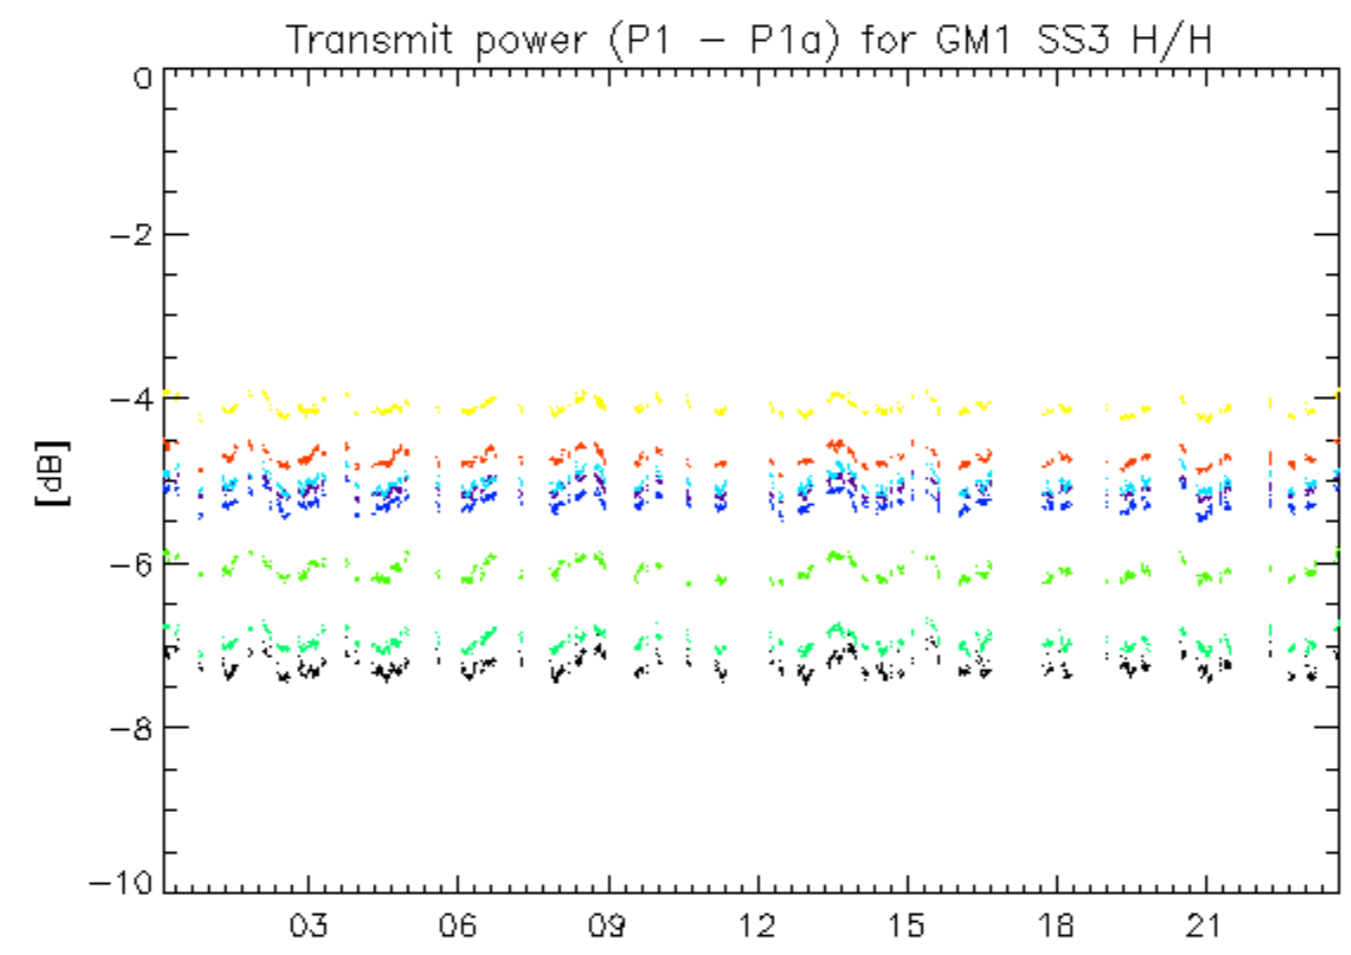



23-Nov  
rows: \_ 1 \_ 5 \_ 9 \_ 13 \_ 17 \_ 21 \_ 25 \_ 29

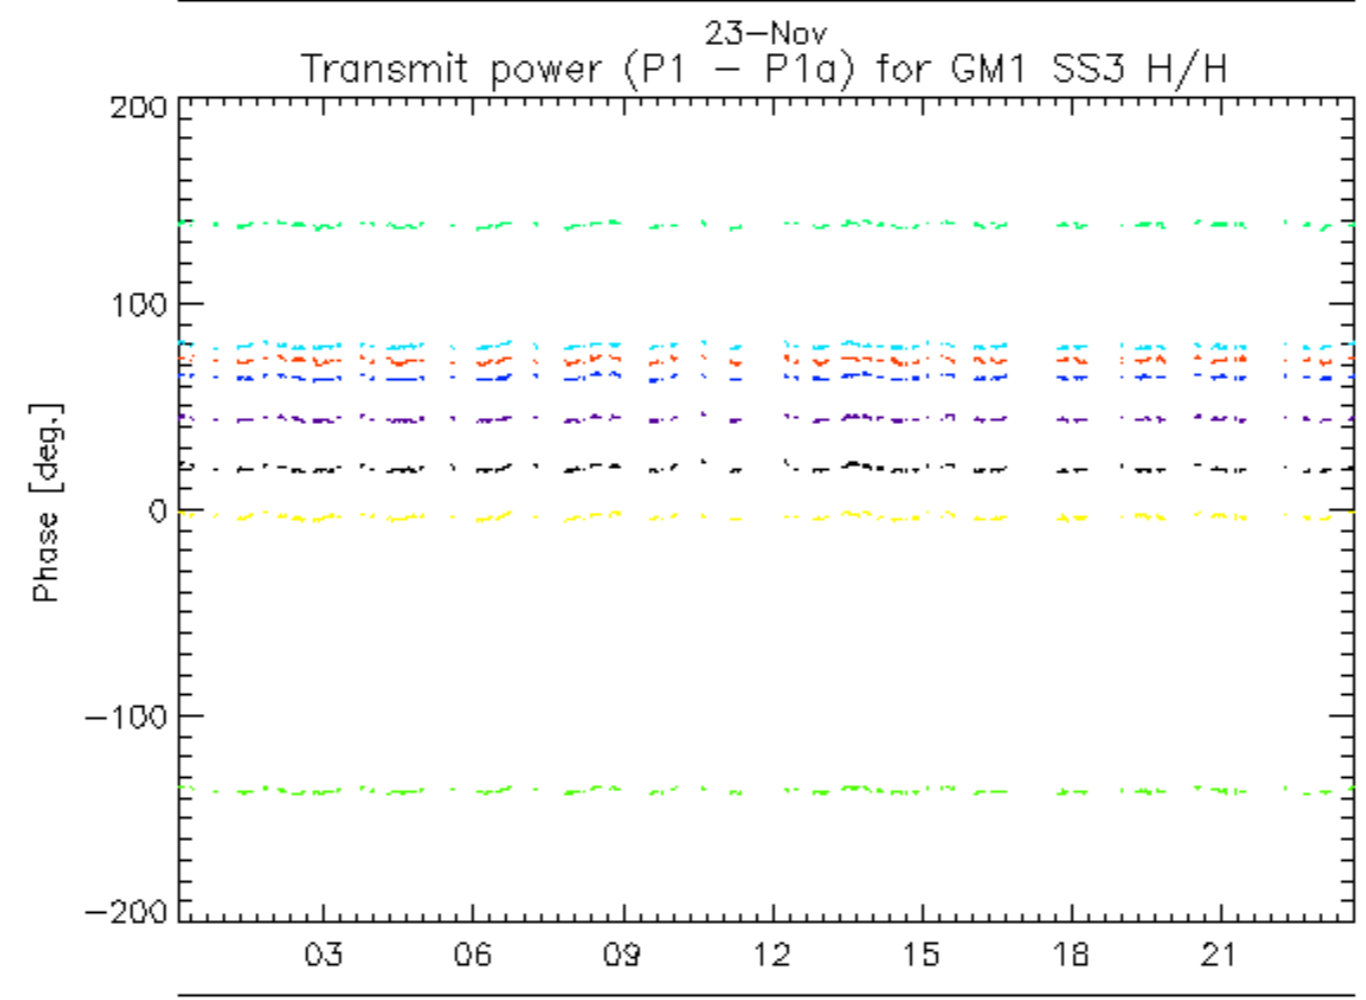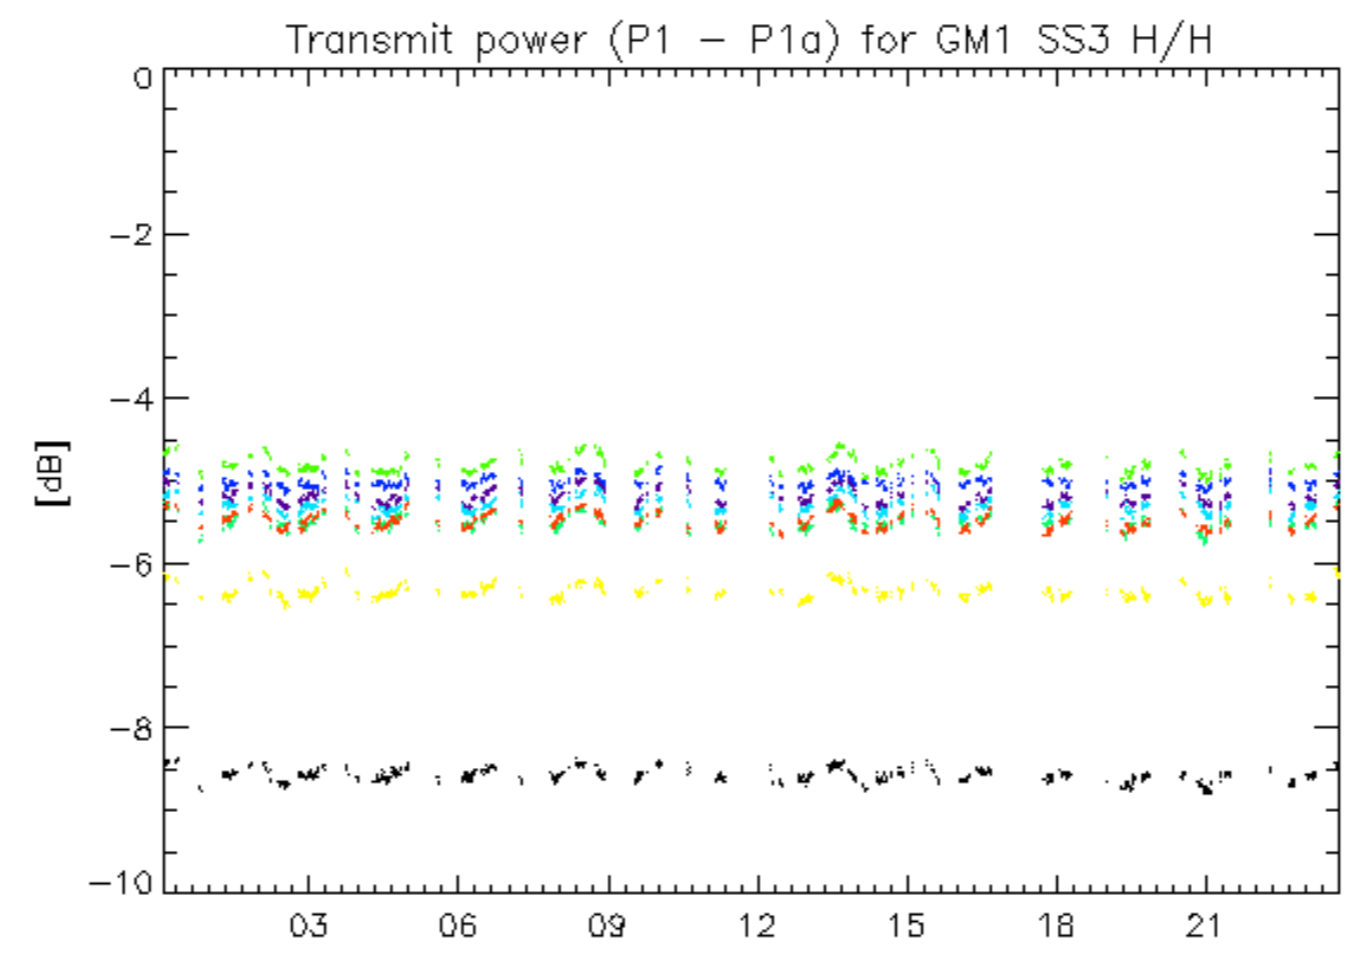



23-Nov  
rows: \_ 2 \_ 6 \_ 10 \_ 14 \_ 18 \_ 22 \_ 26 \_ 30

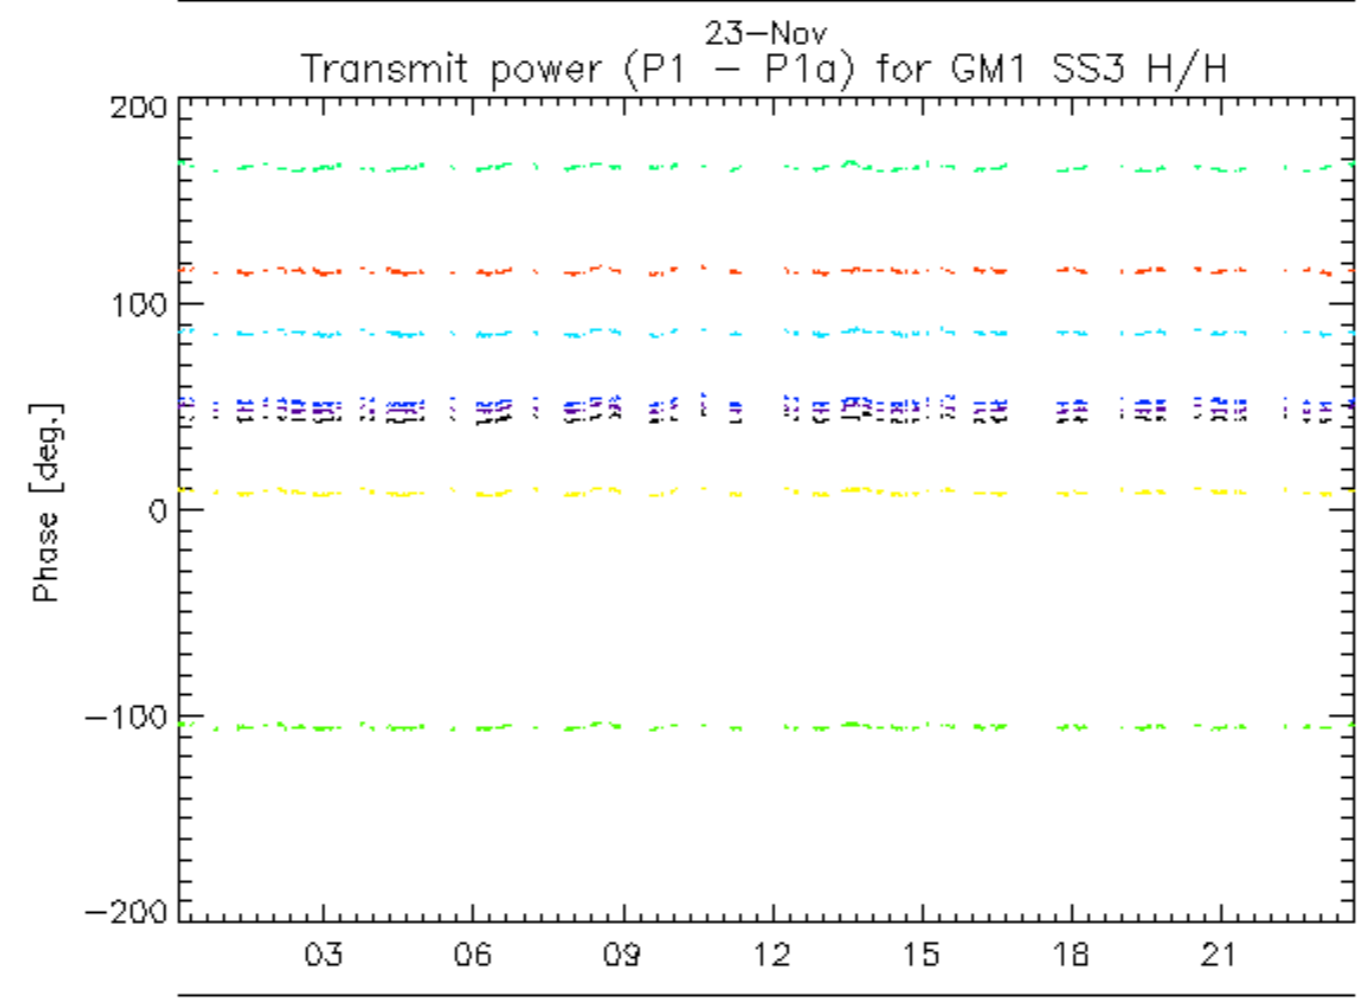
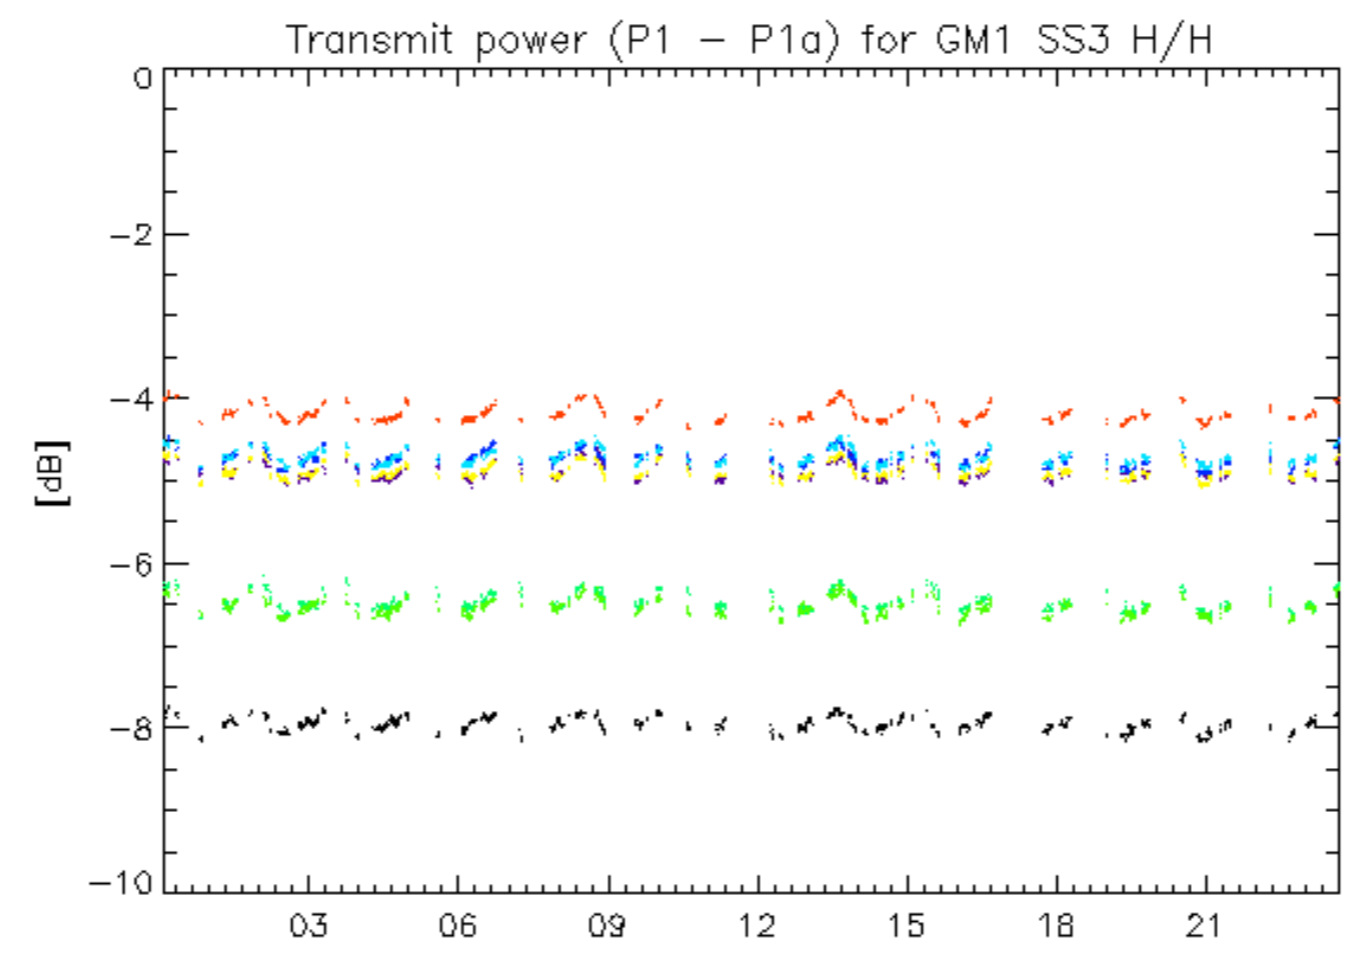


23-Nov  
rows: \_ 3 \_ 7 \_ 11 \_ 15 \_ 19 \_ 23 \_ 27 \_ 31

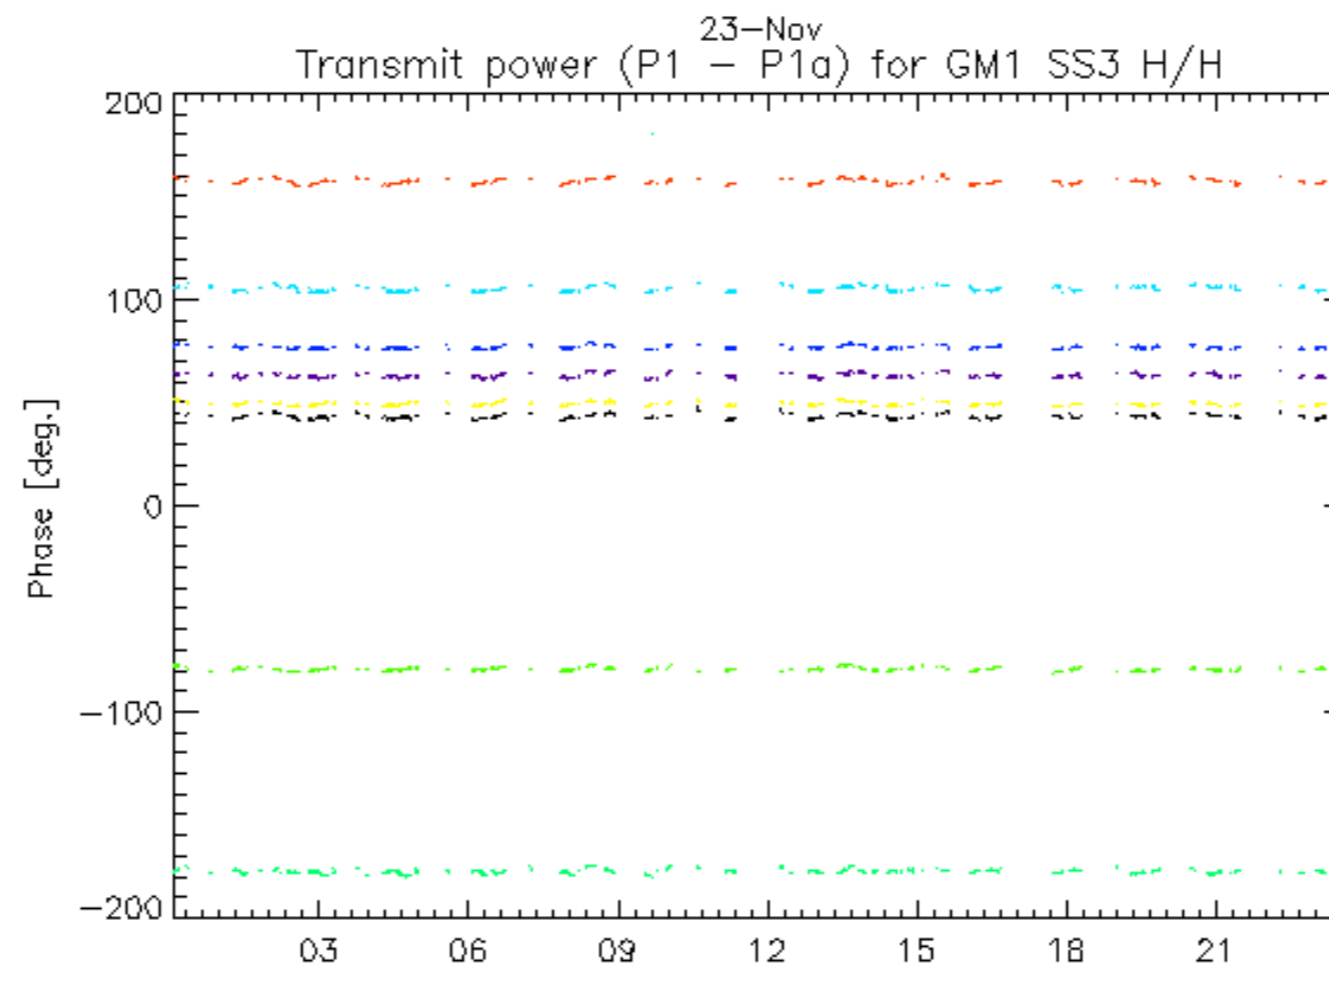
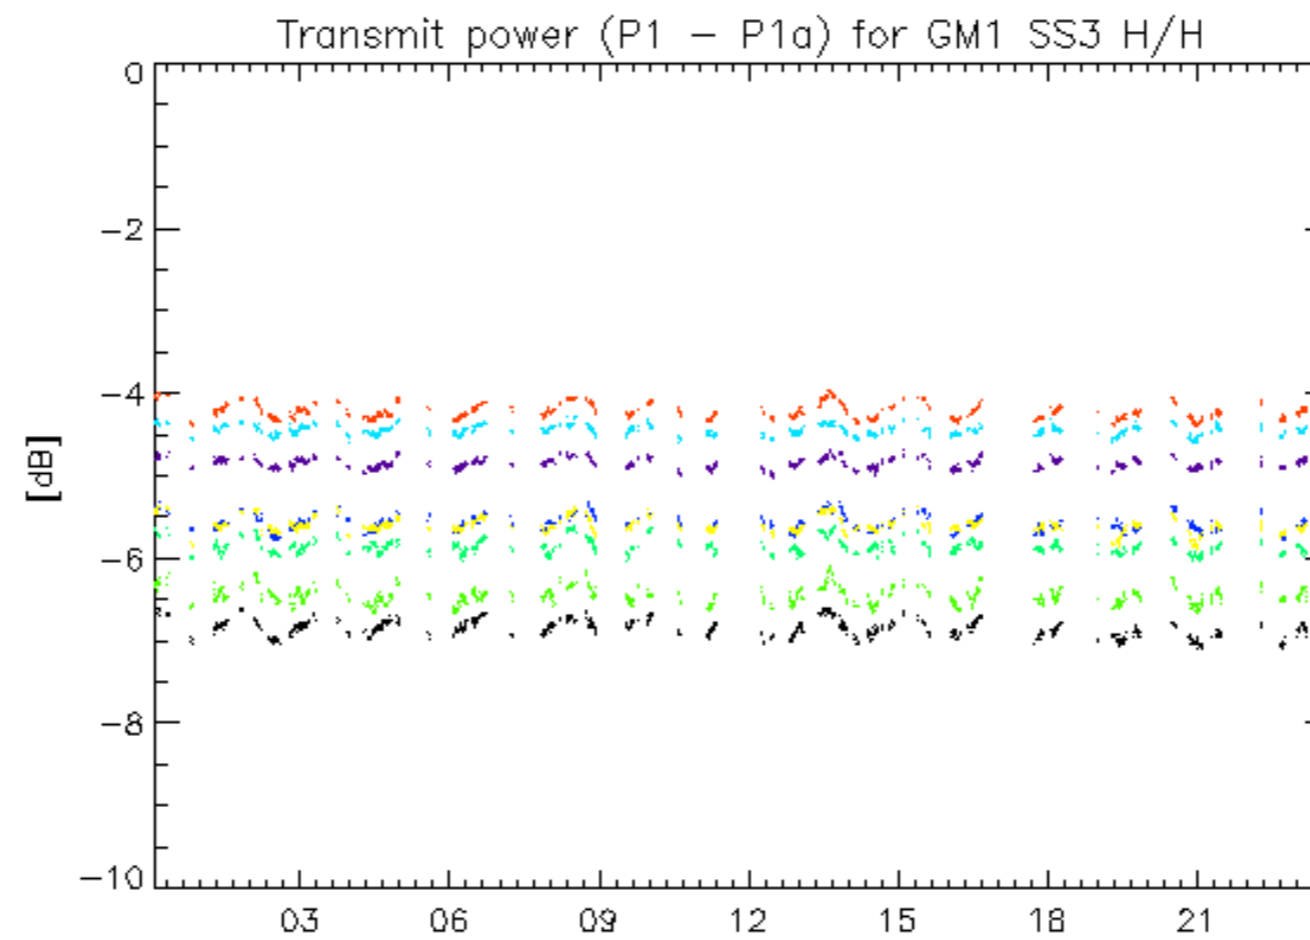




23-Nov  
rows: \_ 4 \_ 8 \_ 12 \_ 16 \_ 20 \_ 24 \_ 28 \_ 32

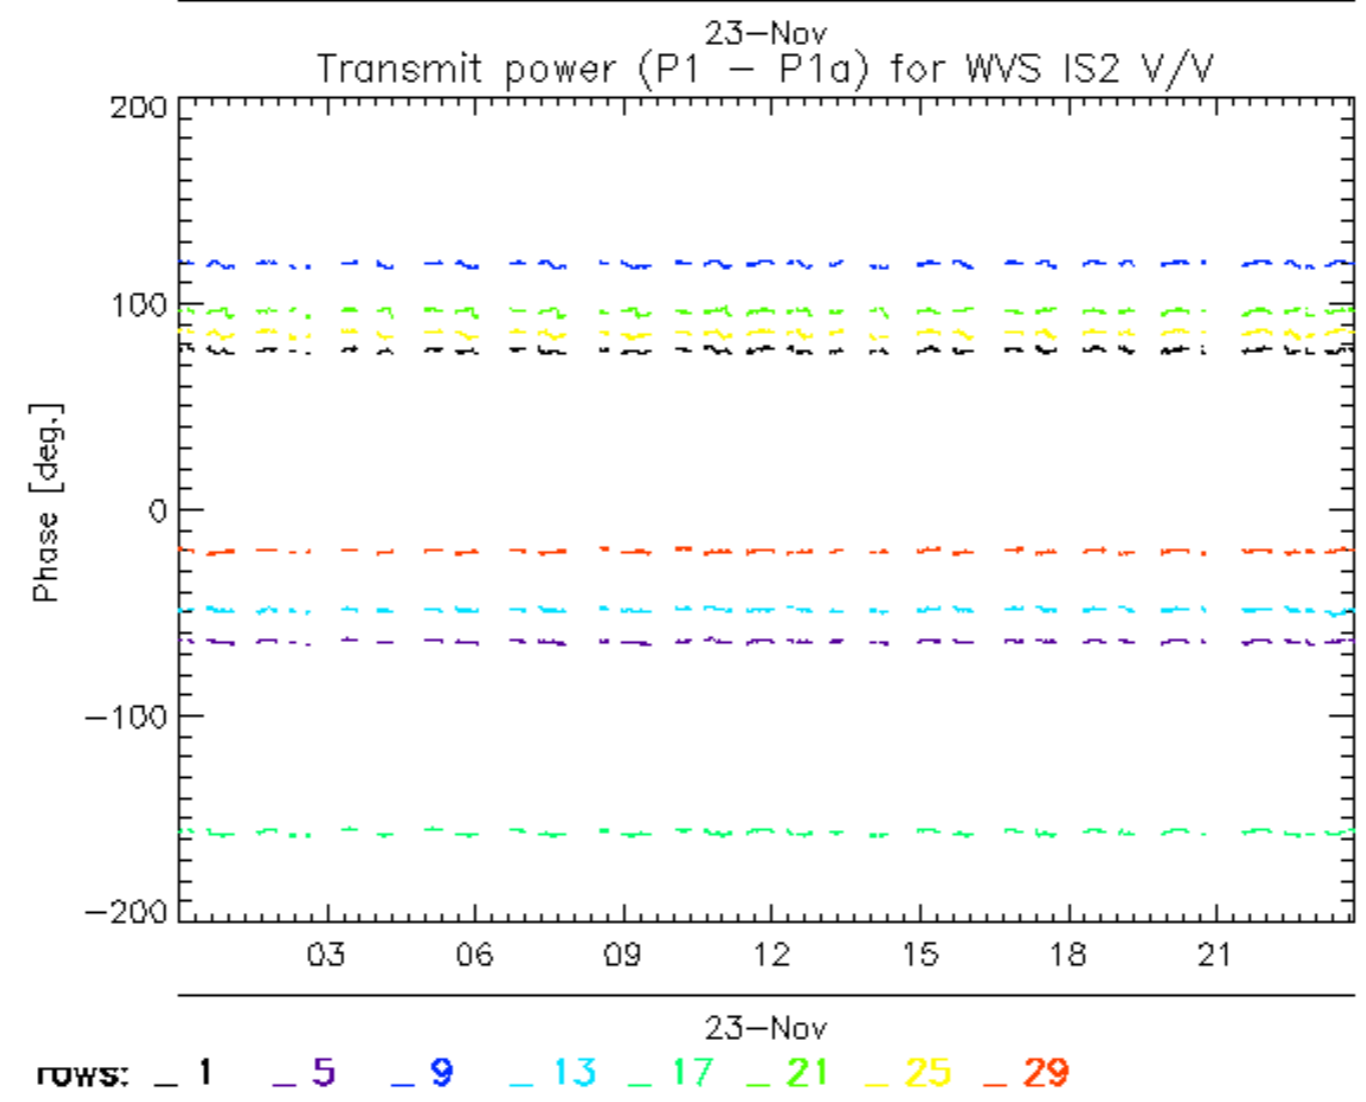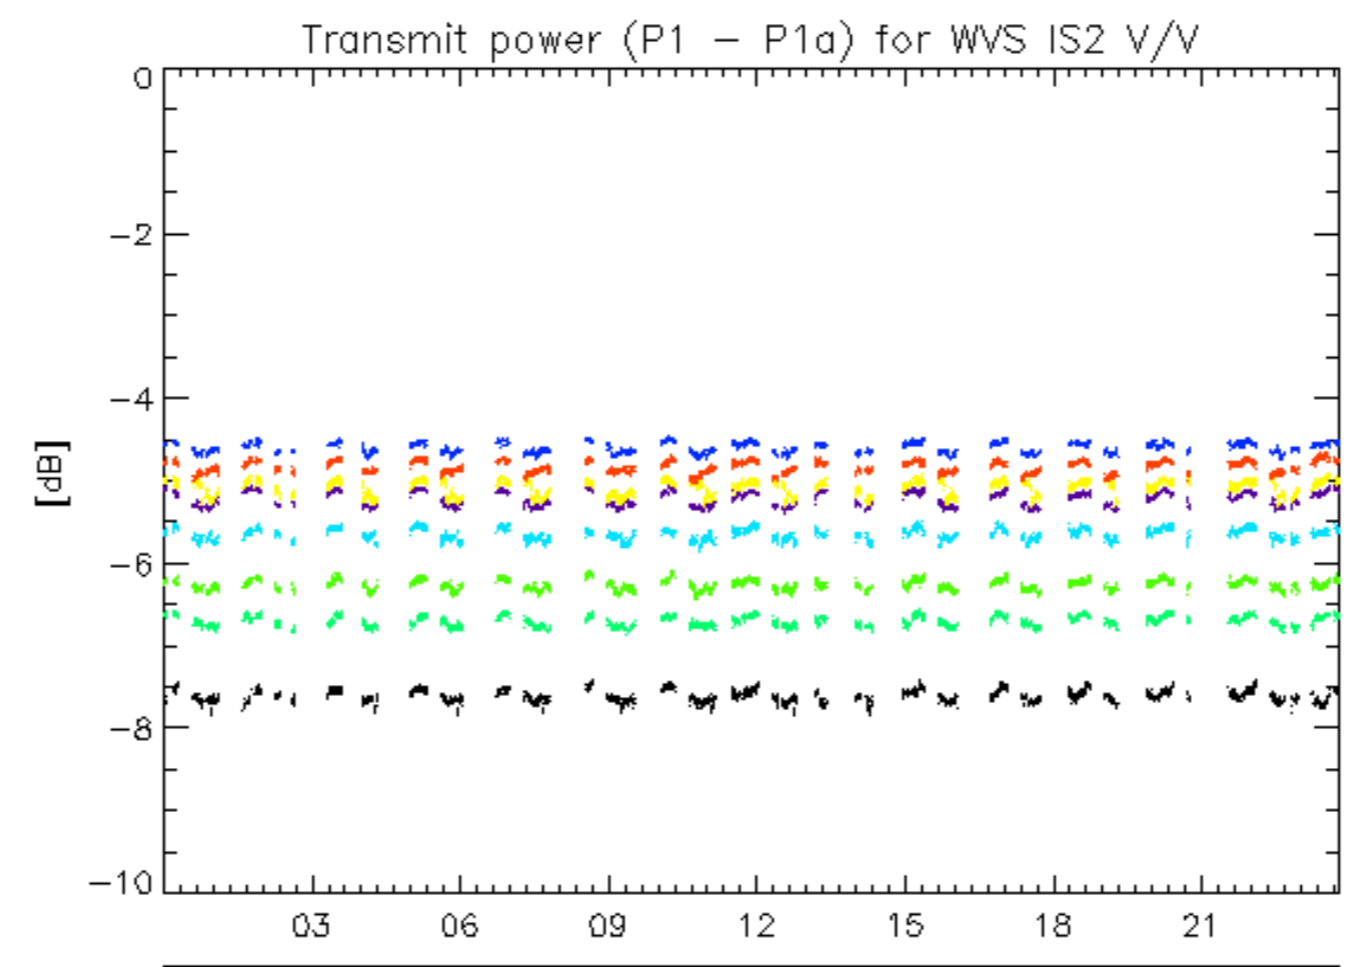


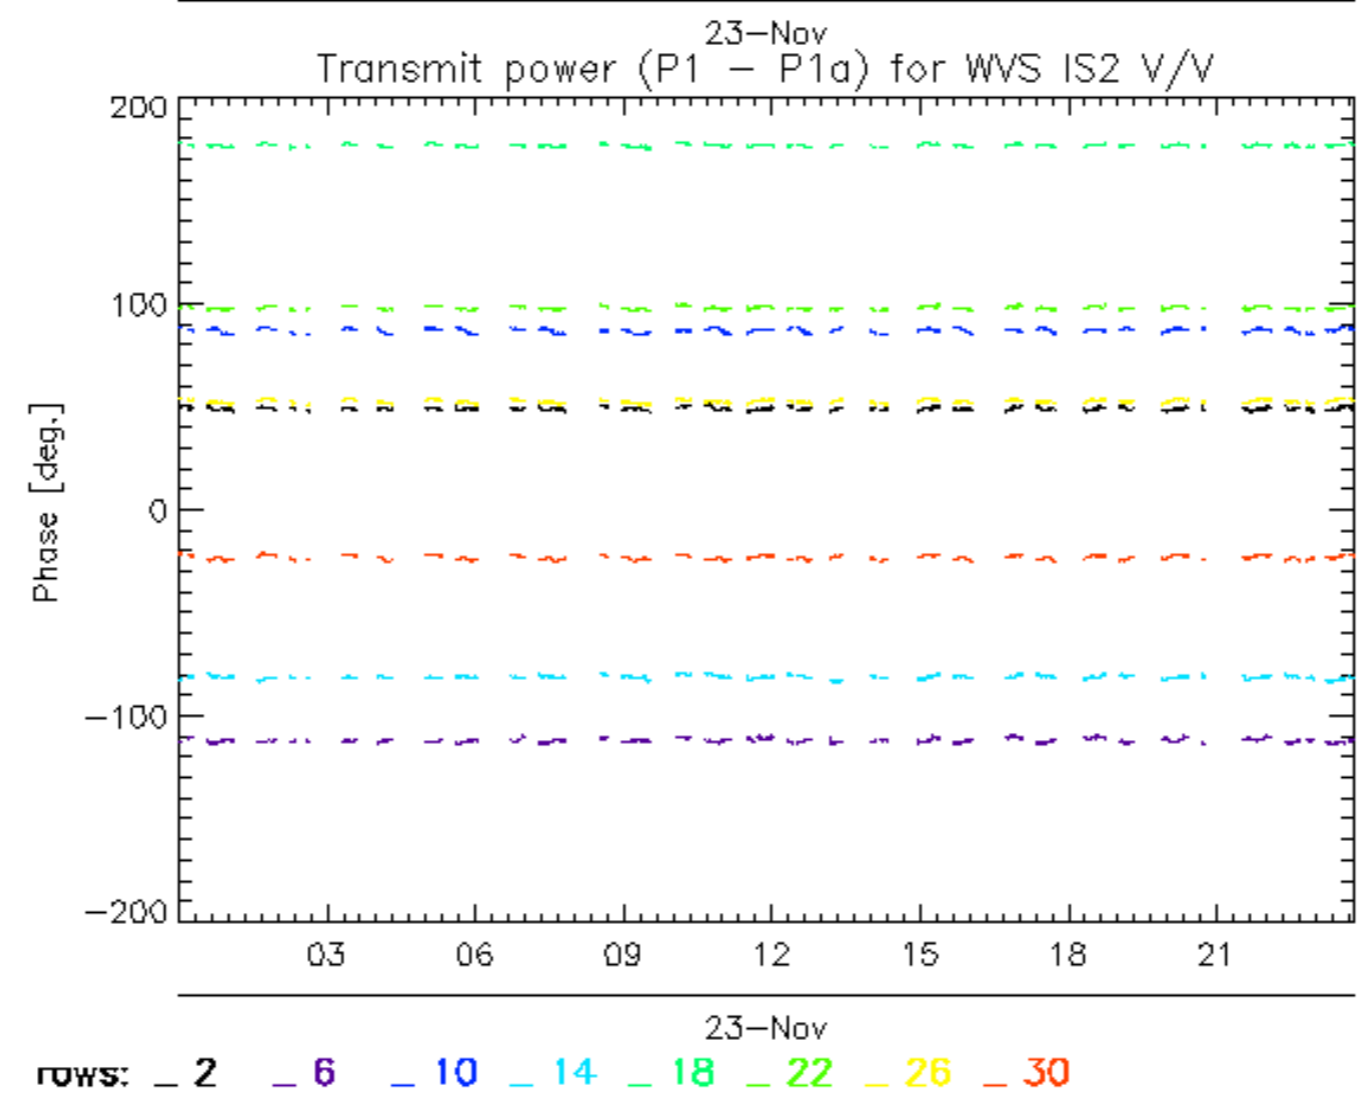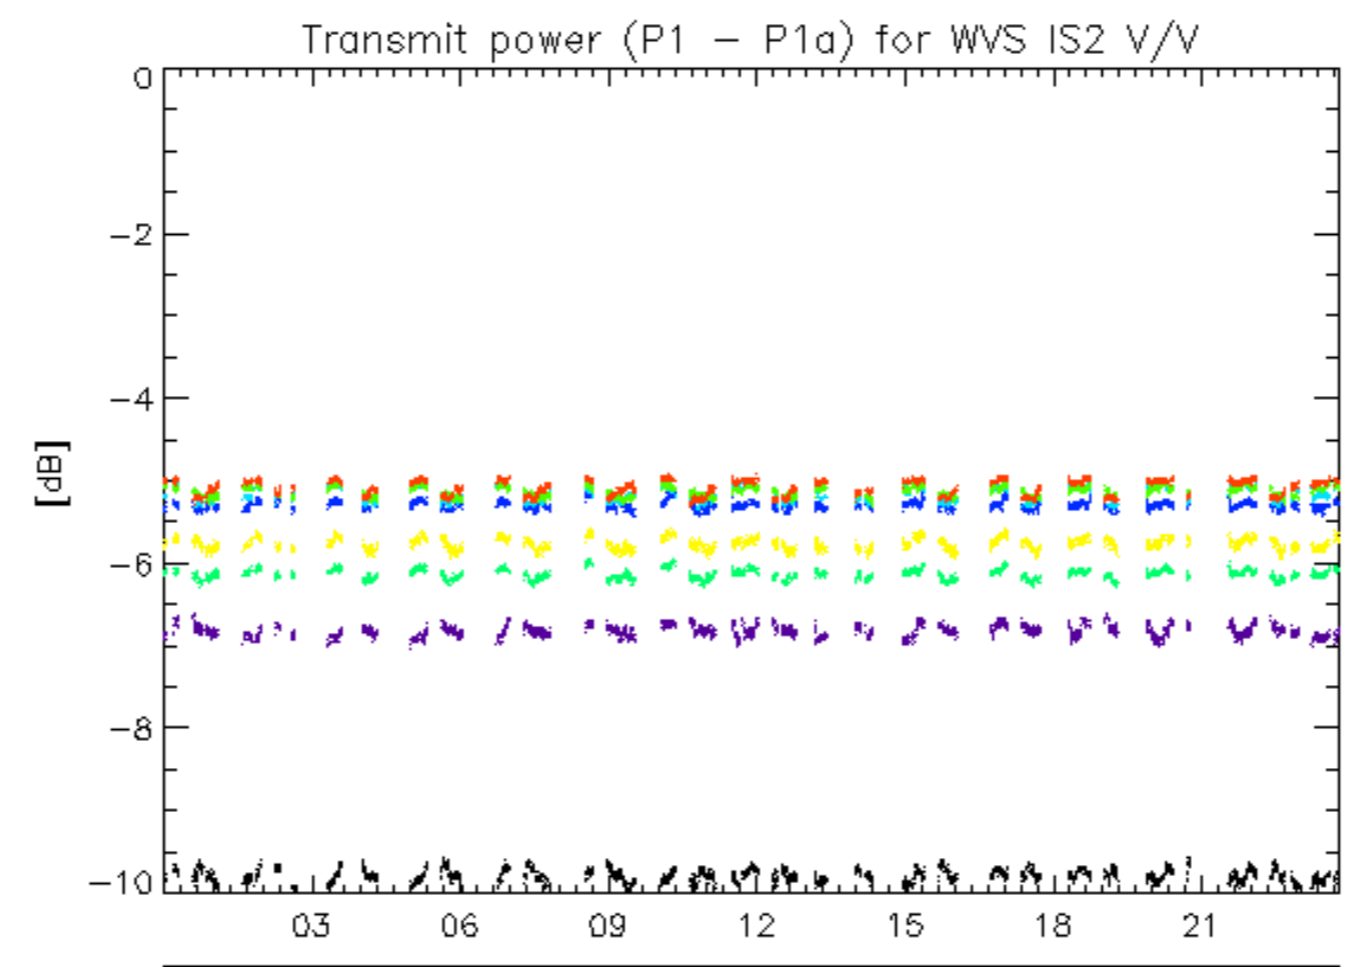





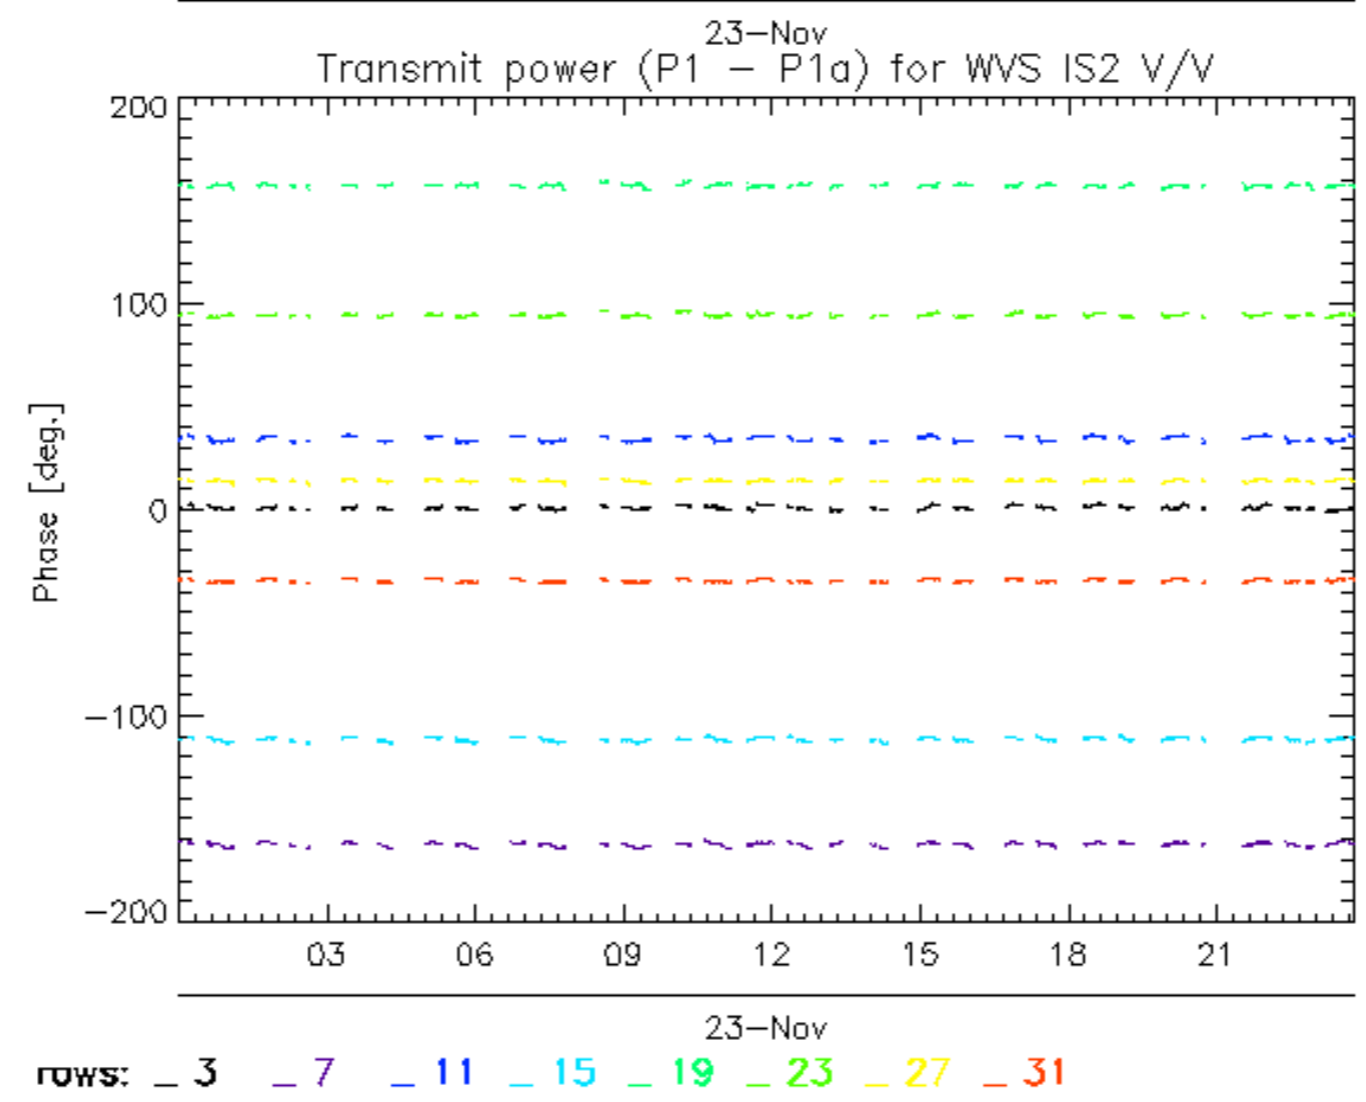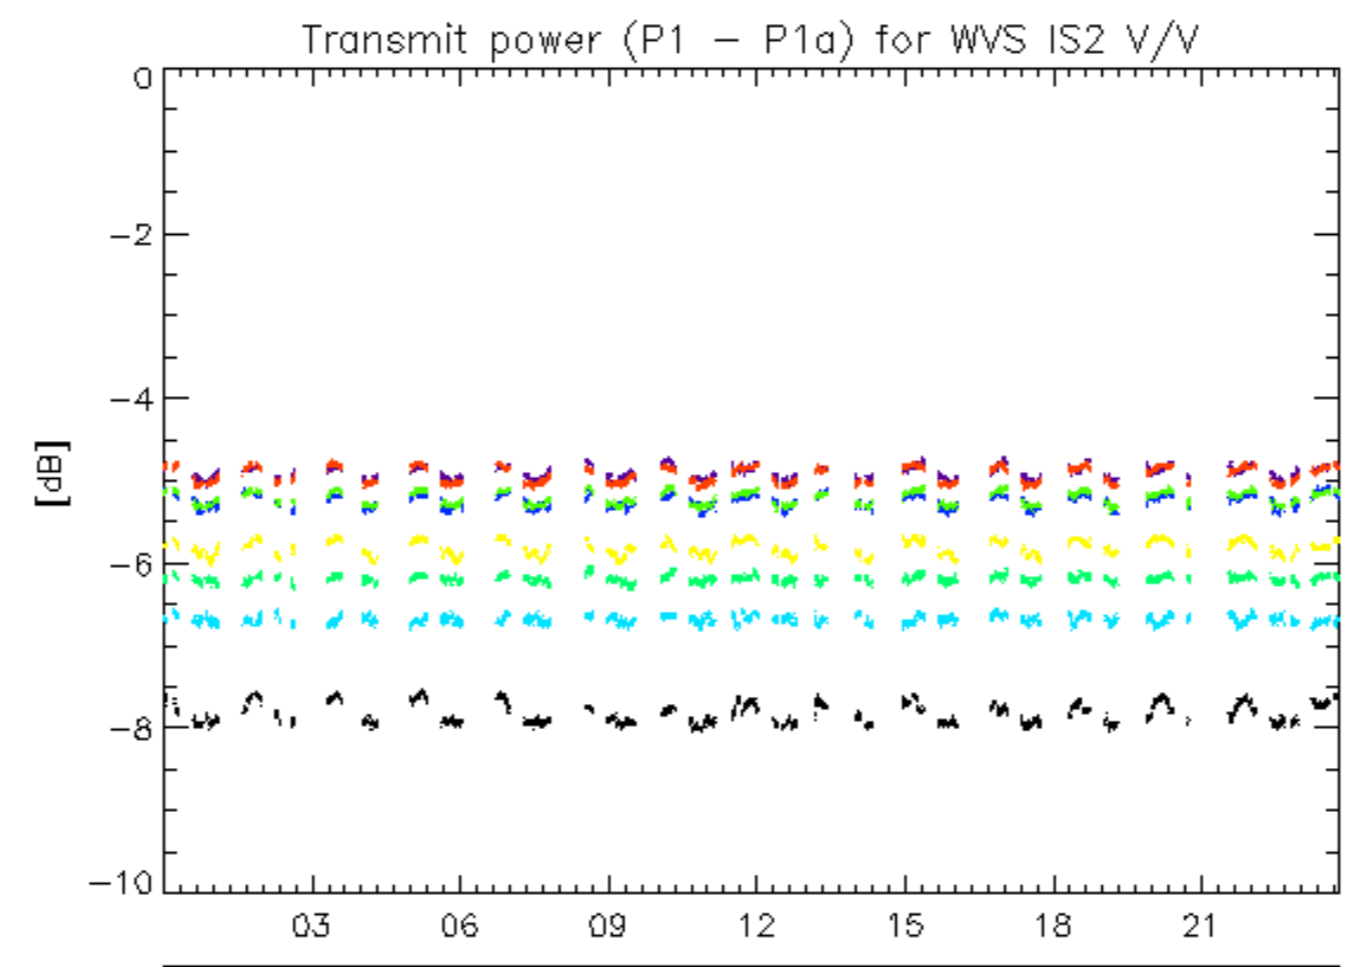


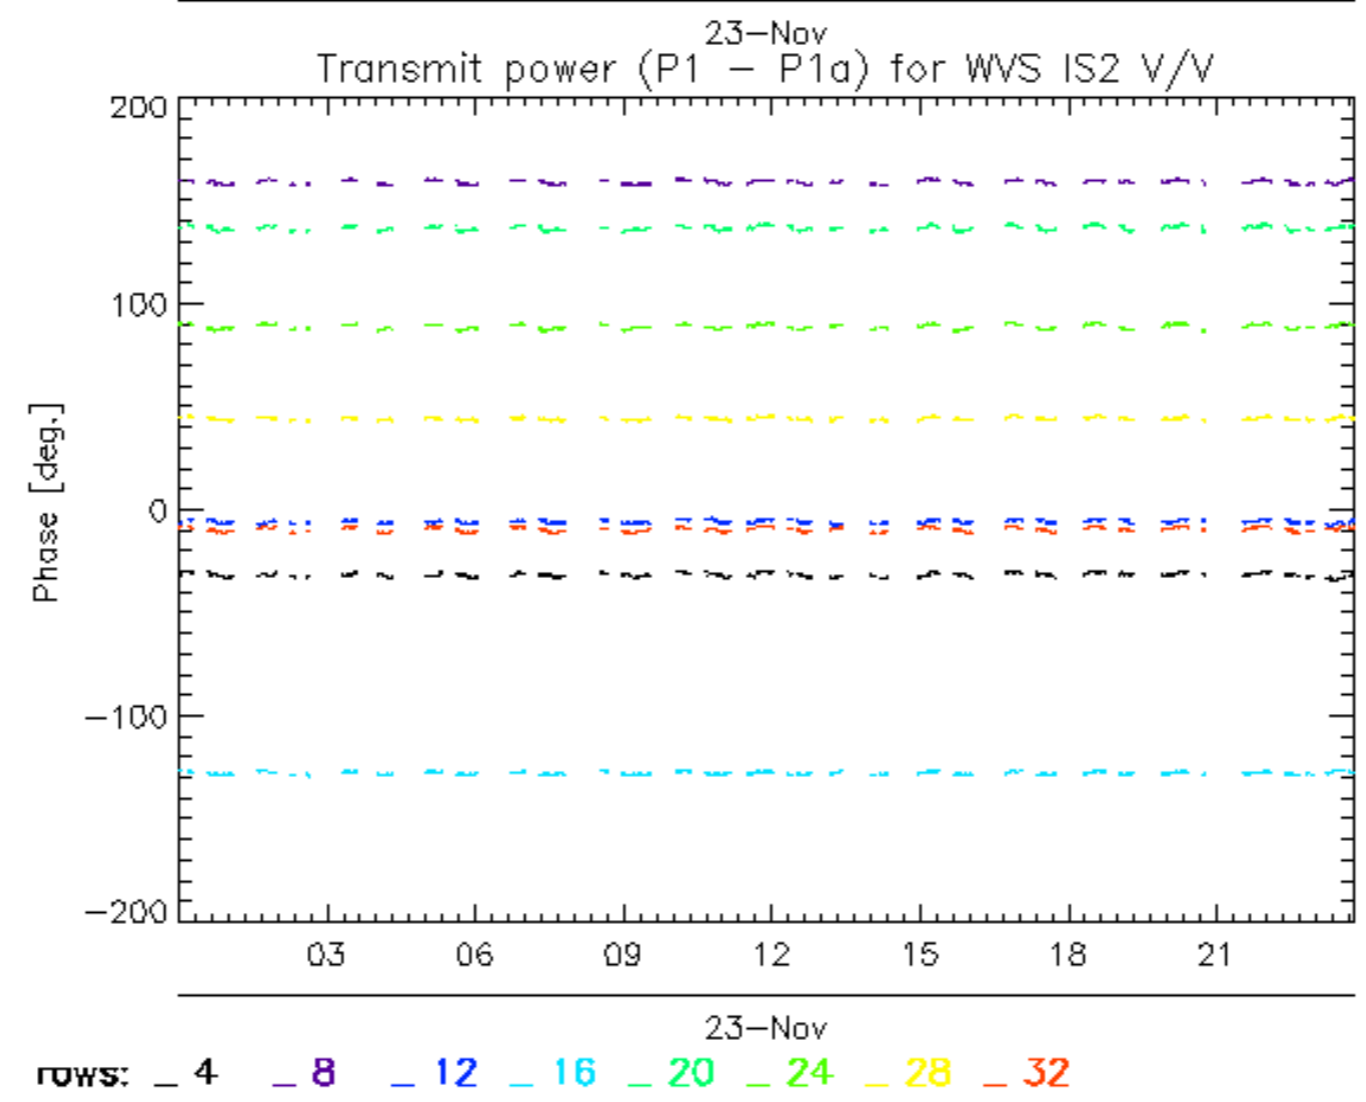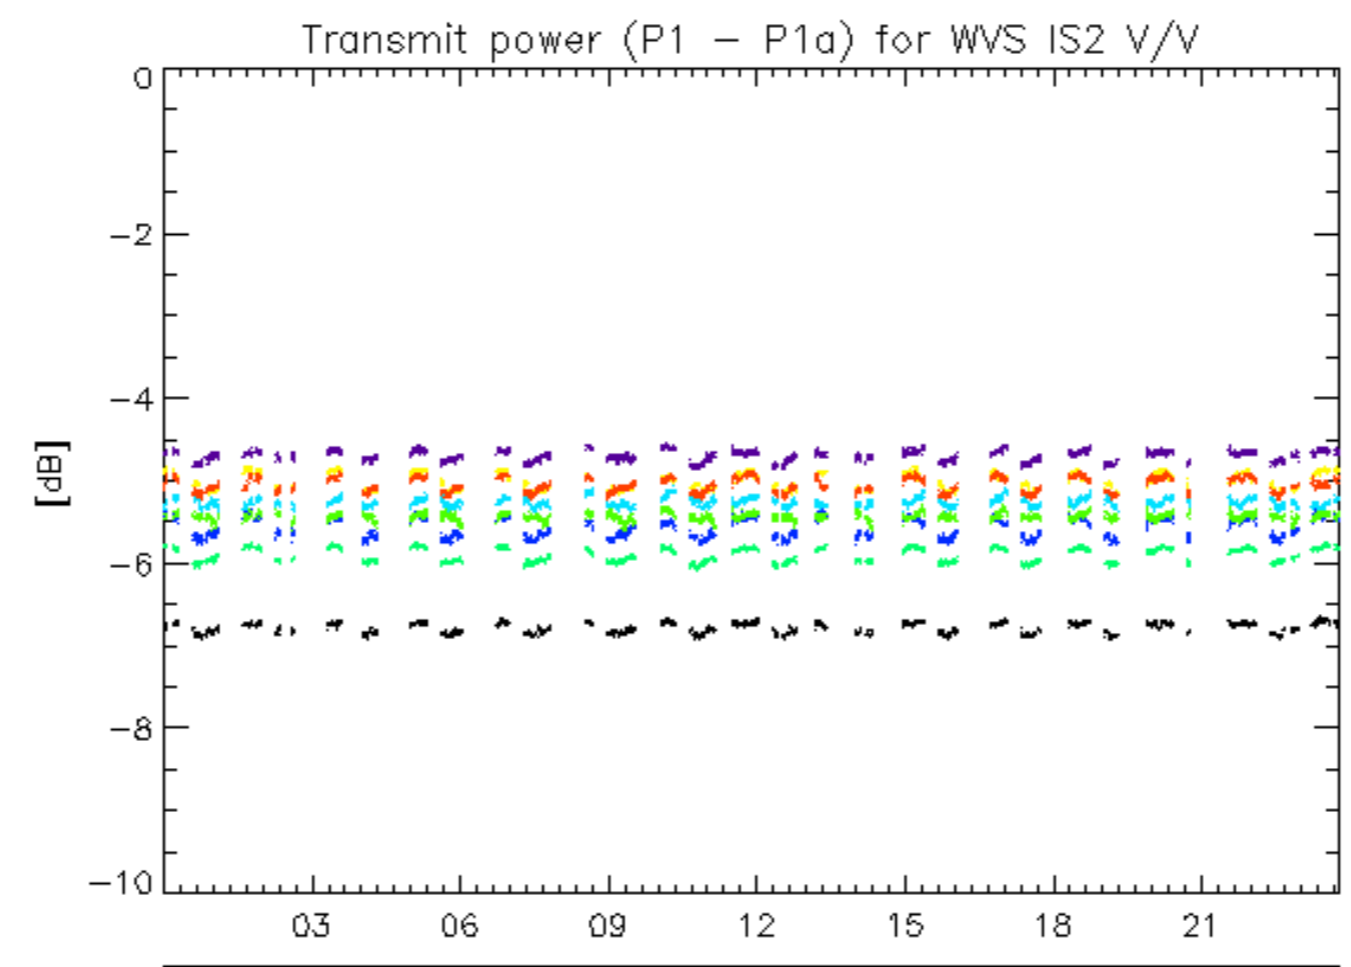

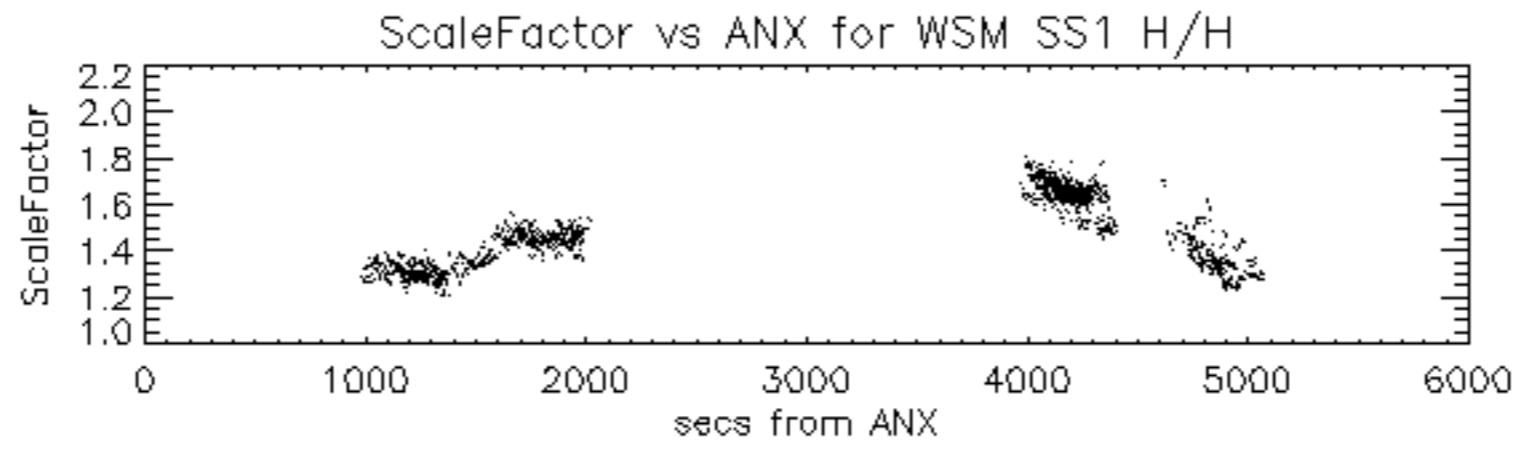

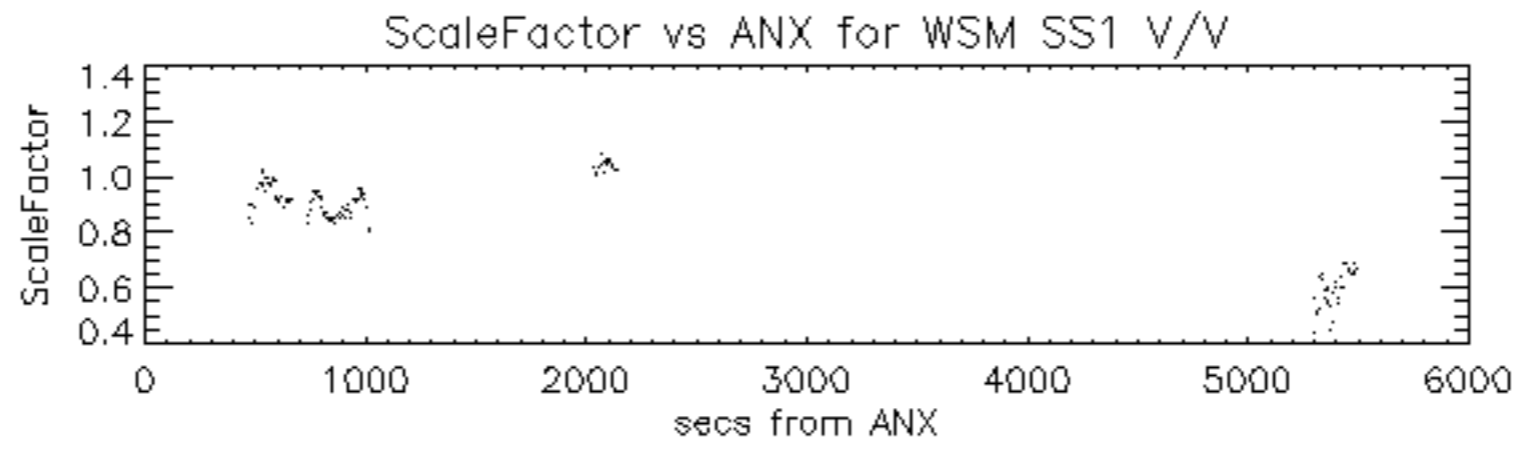

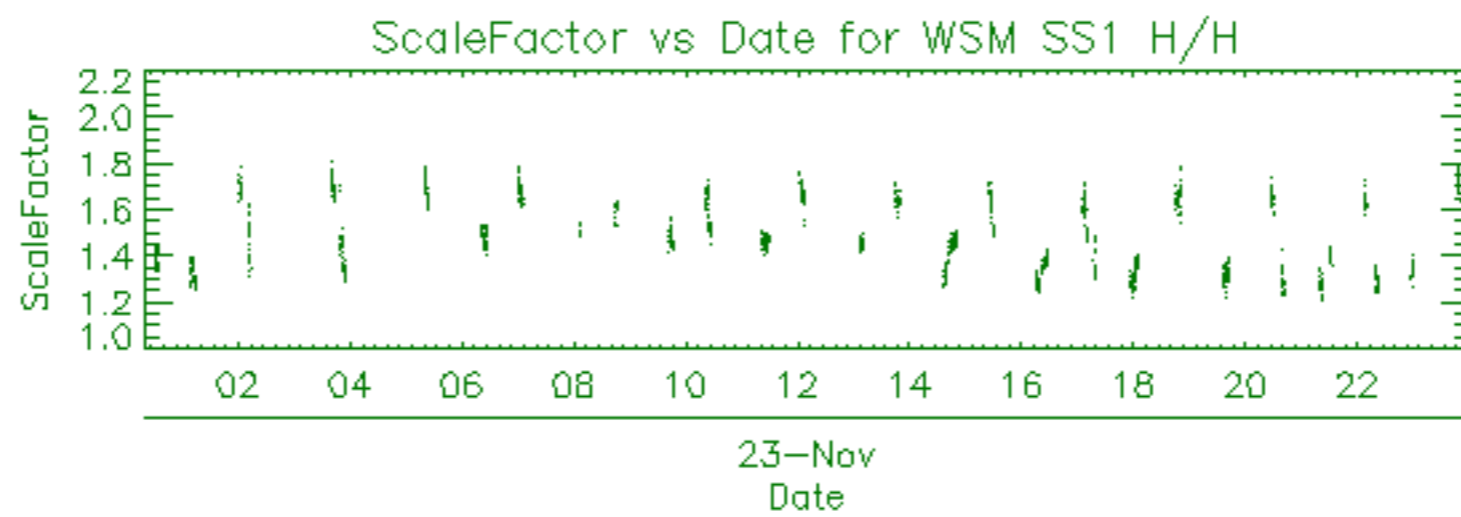

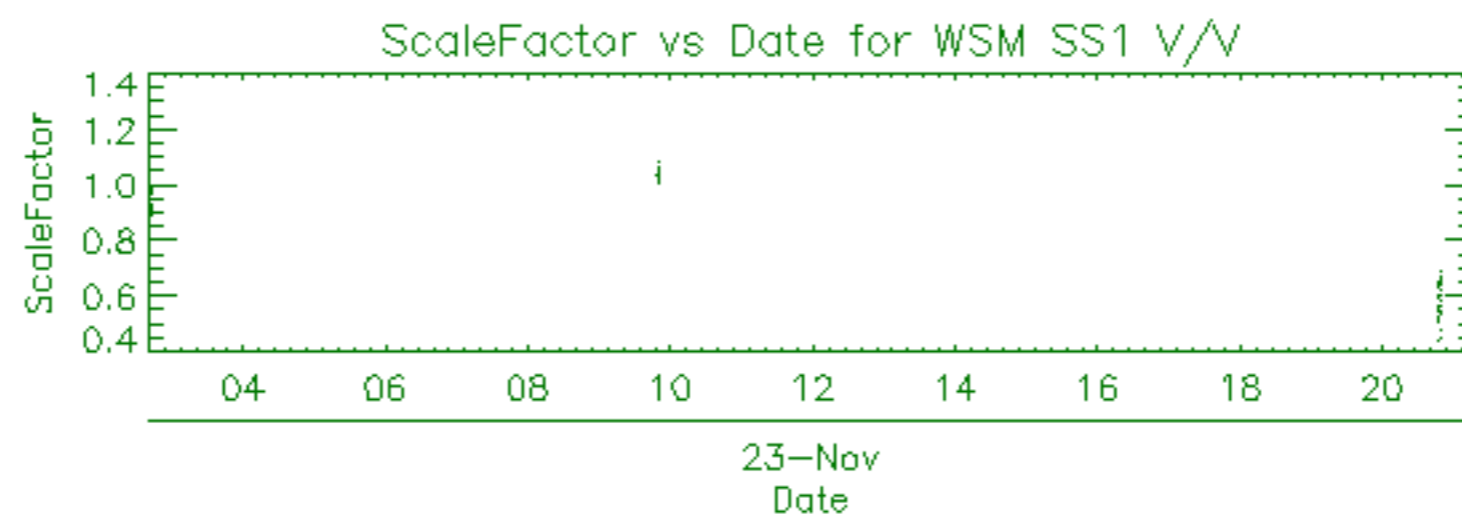

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion			
ASA_APM_1PNPDE20091123_153254_000000432084_00297_40431_0864.N1						IS2	V/H	84	40431 297 4.07



Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_GM1_1PNPDE20091123_000441_000004162084_00288_40422_0383.N1						SS1	H/H	84	40422	288	4.07
ASA_GM1_1PNPDE20091123_001841_000000782084_00288_40422_0378.N1						SS1	H/H	84	40422	288	4.07
ASA_GM1_1PNPDE20091123_002151_000000782084_00288_40422_0393.N1						SS1	H/H	84	40422	288	4.07
ASA_GM1_1PNPDE20091123_004821_000001632084_00288_40422_0933.N1						SS1	H/H	84	40422	288	4.07
ASA_GM1_1PNPDE20091123_011507_000010452084_00289_40423_1007.N1						SS1	H/H	84	40423	289	4.07
ASA_GM1_1PNPDE20091123_014800_000001692084_00289_40423_0927.N1						SS1	H/H	84	40423	289	4.07
ASA_GM1_1PNPDE20091123_020518_000003022084_00289_40423_0931.N1						SS1	H/H	84	40423	289	4.07
ASA_GM1_1PNPDE20091123_021333_000001082084_00289_40423_0925.N1						SS1	H/H	84	40423	289	4.07
ASA_GM1_1PNPDE20091123_022220_000007912084_00289_40423_0959.N1						SS1	H/H	84	40423	289	4.07
ASA_GM1_1PNPDE20091123_024757_000003202084_00290_40424_0923.N1						SS1	H/H	84	40424	290	4.07
ASA_GM1_1PNPDE20091123_025404_000010622084_00290_40424_1083.N1						SS1	H/H	84	40424	290	4.07
ASA_GM1_1PNPDE20091123_031613_000001632084_00290_40424_0968.N1						SS1	H/H	84	40424	290	4.07
ASA_GM1_1PNPDE20091123_034336_000001932084_00290_40424_1035.N1						SS1	H/H	84	40424	290	4.07
ASA_GM1_1PNPDE20091123_035650_000002112084_00290_40424_1033.N1						SS1	H/H	84	40424	290	4.07
ASA_GM1_1PNPDE20091123_041651_000000902084_00291_40425_1053.N1						SS1	H/H	84	40425	291	4.07
ASA_GM1_1PNPDE20091123_042024_000018312084_00291_40425_1107.N1						SS1	H/H	84	40425	291	4.07
ASA_GM1_1PNPDE20091123_045545_000002412084_00291_40425_5487.N1						SS1	H/H	84	40425	291	5.03
ASA_GM1_1PNPDE20091123_053411_000001382084_00291_40425_5485.N1						SS1	H/H	84	40425	291	5.03
ASA_GM1_1PNPDE20091123_060308_000010572084_00292_40426_1169.N1						SS1	H/H	84	40426	292	4.07
ASA_GM1_1PNPDE20091123_061839_000001262084_00292_40426_1093.N1						SS1	H/H	84	40426	292	4.07
ASA_GM1_1PNPDE20091123_061839_000001262084_00292_40426_0410.N1						SS1	H/H	84	40426	292	4.07
ASA_GM1_1PNPDE20091123_062712_000010092084_00292_40426_0510.N1						SS1	H/H	84	40426	292	4.07
ASA_GM1_1PNPDK20091123_071403_000001872084_00292_40426_6888.N1						SS1	H/H	84	40426	292	4.07
ASA_GM1_1PNPDK20091123_075112_000006822084_00293_40427_6890.N1						SS1	H/H	84	40427	293	4.07
ASA_GM1_1PNPDK20091123_080131_000003082084_00293_40427_6922.N1						SS1	H/H	84	40427	293	4.07
ASA_GM1_1PNPDK20091123_081318_000000902084_00293_40427_6924.N1						SS1	H/H	84	40427	293	4.07
ASA_GM1_1PNPDK20091123_082035_000007002084_00293_40427_6926.N1						SS1	H/H	84	40427	293	4.07
ASA_GM1_1PNPDK20091123_084257_000000902084_00293_40427_6928.N1						SS1	H/H	84	40427	293	4.07
ASA_GM1_1PNPDK20091123_084603_000007002084_00293_40427_6933.N1						SS1	H/H	84	40427	293	4.07
ASA_GM1_1PNPDK20091123_093221_000005732084_00294_40428_6939.N1						SS1	H/H	84	40428	294	4.07
ASA_GM1_1PNPDK20091123_094612_000000782084_00294_40428_6967.N1						SS1	H/H	84	40428	294	4.07
ASA_GM1_1PNPDK20091123_095816_000003502084_00294_40428_6969.N1						SS1	H/H	84	40428	294	4.07
ASA_GM1_1PNPDK20091123_103450_000002112084_00294_40428_6974.N1						SS1	H/H	84	40428	294	4.07
ASA_GM1_1PNPDK20091123_110947_000007312084_00295_40429_6976.N1						SS1	H/H	84	40429	295	4.07
ASA_GM1_1PNPDK20091123_121607_000001692084_00295_40429_7015.N1						SS1	H/H	84	40429	295	4.07
ASA_GM1_1PNPDK20091123_122625_000002412084_00295_40429_7023.N1						SS1	H/H	84	40429	295	4.07
ASA_GM1_1PNPDK20091123_124811_000009122084_00296_40430_7028.N1						SS1	H/H	84	40430	296	4.07
ASA_GM1_1PNPDK20091123_130210_000002352084_00296_40430_7061.N1						SS1	H/H	84	40430	296	4.07
ASA_GM1_1PNPDK20091123_132453_000006522084_00296_40430_7063.N1						SS1	H/H	84	40430	296	4.07
ASA_GM1_1PNPDK20091123_133552_000003682084_00296_40430_7065.N1						SS1	H/H	84	40430	296	4.07
ASA_GM1_1PNPDK20091123_134328_000000722084_00296_40430_7067.N1						SS1	H/H	84	40430	296	4.07
ASA_GM1_1PNPDK20091123_134919_000006102084_00296_40430_7075.N1						SS1	H/H	84	40430	296	4.07
ASA_GM1_1PNPDK20091123_140718_000002832084_00296_40430_7077.N1						SS1	H/H	84	40430	296	4.07
ASA_GM1_1PNPDK20091123_142345_000007672084_00297_40431_7079.N1						SS1	H/H	84	40431	297	4.07
ASA_GM1_1PNPDK20091123_144008_000001142084_00297_40431_7107.N1						SS1	H/H	84	40431	297	4.07
ASA_GM1_1PNPDK20091123_145000_000003562084_00297_40431_7109.N1						SS1	H/H	84	40431	297	4.07
ASA_GM1_1PNPDK20091123_150619_000001572084_00297_40431_7114.N1						SS1	H/H	84	40431	297	4.07
ASA_GM1_1PNPDK20091123_152404_000000842084_00297_40431_7116.N1						SS1	H/H	84	40431	297	4.07
ASA_GM1_1PNPDK20091123_153008_000001692084_00297_40431_7118.N1						SS1	H/H	84	40431	297	4.07
ASA_GM1_1PNPDK20091123_153623_000002232084_00297_40431_7123.N1						SS1	H/H	84	40431	297	4.07
ASA_GM1_1PNPDK20091123_160304_000007252084_00298_40432_7125.N1						SS1	H/H	84	40432	298	4.07
ASA_GM1_1PNPDK20091123_162423_000001082084_00298_40432_7156.N1						SS1	H/H	84	40432	298	4.07
ASA_GM1_1PNPDK20091123_162748_000006102084_00298_40432_7158.N1						SS1	H/H	84	40432	298	4.07
ASA_GM1_1PNPDK20091123_163846_000002472084_00298_40432_7165.N1						SS1	H/H	84	40432	298	4.07
ASA_GM1_1PNPDK20091123_174442_000001082084_00299_40433_7163.N1						SS1	H/H	84	40433	299	4.07
ASA_GM1_1PNPDK20091123_174830_000004532084_00299_40433_7167.N1						SS1	H/H	84	40433	299	4.07
ASA_GM1_1PNPDK20091123_175449_000001202084_00299_40433_7193.N1						SS1	H/H	84	40433	299	4.07
ASA_GM1_1PNPDK20091123_180431_000007732084_00299_40433_7195.N1						SS1	H/H	84	40433	299	4.07
ASA_GM1_1PNPDK20091123_185958_000000782084_00299_40433_7205.N1						SS1	H/H	84	40433	299	4.07
ASA_GM1_1PNPDK20091123_191815_000001382084_00299_40433_7200.N1						SS1	H/H	84	40433	299	4.07
ASA_GM1_1PNPDK20091123_192305_000007122084_00300_40434_7207.N1						SS1	H/H	84	40434	300	4.07
ASA_GM1_1PNPDE20091123_194309_000005432084_00300_40434_0677.N1						SS1	H/H	84	40434	300	4.07
ASA_GM1_1PNPDE20091123_194309_000005432084_00300_40434_1151.N1						SS1	H/H	84	40434	300	4.07
ASA_GM1_1PNPDE20091123_203018_000003022084_00300_40434_1149.N1						SS1	H/H	84	40434	300	4.07
ASA_GM1_1PNPDE20091123_203018_000003022084_00300_40434_0702.N1						SS1	H/H	84	40434	300	4.07
ASA_GM1_1PNPDE20091123_205020_000010752084_00300_40434_1193.N1						SS1	H/H	84	40434	300	4.07
ASA_GM1_1PNPDE20091123_211632_000001692084_00301_40435_1147.N1						SS1	H/H	84	40435	301	4.07



ASA_GM1_1PNPDE20091123_212224_000004532084_00301_40435_5490.N1	SS1	H/H	84	40435	301	5.03
ASA_GM1_1PNPDE20091123_221614_000001872084_00301_40435_1159.N1	SS1	H/H	84	40435	301	4.07
ASA_GM1_1PNPDE20091123_224037_000003982084_00302_40436_5489.N1	SS1	H/H	84	40436	302	5.03
ASA_GM1_1PNPDE20091123_230113_000007182084_00302_40436_1165.N1	SS1	H/H	84	40436	302	4.07
ASA_GM1_1PNPDE20091123_233542_000002232084_00302_40436_1157.N1	SS1	H/H	84	40436	302	4.07
ASA_GM1_1PNPDE20091123_233929_000000962084_00302_40436_5488.N1	SS1	H/H	84	40436	302	5.03
ASA_GM1_1PNPDE20091123_233929_000000962084_00302_40436_5511.N1	SS1	H/H	84	40436	302	5.03


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20091123_002306_000003722084_00288_40422_0667.N1						IS2	H/H	84	40422	288	4.07
ASA_IMM_1PNPDE20091123_020335_000000922084_00289_40423_0918.N1						IS2	H/H	84	40423	289	4.07
ASA_IMM_1PNPDE20091123_031146_000002552084_00290_40424_1143.N1						IS2	V/V	84	40424	290	4.07
ASA_IMM_1PNPDE20091123_031250_000000592084_00290_40424_0880.N1						IS2	V/V	84	40424	290	4.07
ASA_IMM_1PNPDE20091123_031449_000000722084_00290_40424_0929.N1						IS2	V/V	84	40424	290	4.07
ASA_IMM_1PNPDE20091123_034647_000000922084_00290_40424_5597.N1						IS2	H/H	84	40424	290	5.03
ASA_IMM_1PNPDE20091123_045115_000002582084_00291_40425_5595.N1						IS2	V/V	84	40425	291	5.03
ASA_IMM_1PNPDE20091123_045115_000002582084_00291_40425_5598.N1						IS2	V/V	84	40425	291	5.03
ASA_IMM_1PNPDE20091123_045115_000000632084_00291_40425_1023.N1						IS2	V/V	84	40425	291	4.07
ASA_IMM_1PNPDE20091123_045517_000000152084_00291_40425_1031.N1						IS2	***	84	40425	291	4.07
ASA_IMM_1PNPDE20091123_052527_000000922084_00291_40425_5628.N1						IS2	H/H	84	40425	291	5.03
ASA_IMM_1PNPDE20091123_052631_000000282084_00291_40425_1001.N1						IS2	H/H	84	40425	291	4.07
ASA_IMM_1PNPDE20091123_052747_000001832084_00291_40425_1265.N1						IS2	H/H	84	40425	291	4.07
ASA_IMM_1PNPDE20091123_052747_000003762084_00291_40425_5660.N1						IS2	H/H	84	40425	291	5.03
ASA_IMM_1PNPDE20091123_053150_000001332084_00291_40425_1266.N1						IS2	H/H	84	40425	291	4.07
ASA_IMM_1PNPDE20091123_070540_000001622084_00292_40426_1057.N1						IS2	H/H	84	40426	292	4.07
ASA_IMM_1PNPDK20091123_070910_000002832084_00292_40426_6918.N1						IS2	H/H	84	40426	292	4.07
ASA_IMM_1PNPDK20091123_074931_000000892084_00293_40427_6916.N1						IS2	V/V	84	40427	293	4.07
ASA_IMM_1PNPDE20091123_080838_000000632084_00293_40427_0628.N1						IS2	V/V	84	40427	293	4.07
ASA_IMM_1PNPDE20091123_080838_000001532084_00293_40427_1037.N1						IS2	V/V	84	40427	293	4.07
ASA_IMM_1PNPDE20091123_081041_000000302084_00293_40427_0632.N1						IS2	V/V	84	40427	293	4.07
ASA_IMM_1PNPDE20091123_081606_000002592084_00293_40427_1139.N1						IS2	V/V	84	40427	293	4.07
ASA_IMM_1PNPDE20091123_081606_000002592084_00293_40427_0772.N1						IS2	V/V	84	40427	293	4.07
ASA_IMM_1PNPDK20091123_094730_000000372084_00294_40428_6944.N1						IS7	V/V	84	40428	294	4.07
ASA_IMM_1PNPDE20091123_095222_000002422084_00294_40428_1263.N1						IS2	V/V	84	40428	294	4.07
ASA_IMM_1PNPDE20091123_095222_000003022084_00294_40428_5599.N1						IS2	V/V	84	40428	294	5.03
ASA_IMM_1PNPDE20091123_095222_000003012084_00294_40428_0798.N1						IS2	V/V	84	40428	294	4.07
ASA_IMM_1PNPDE20091123_102931_000000632084_00294_40428_1095.N1						IS2	H/H	84	40428	294	4.07
ASA_IMM_1PNPDE20091123_102931_000000922084_00294_40428_1145.N1						IS2	H/H	84	40428	294	4.07
ASA_IMM_1PNPDE20091123_103036_000002432084_00294_40428_5608.N1						IS2	H/H	84	40428	294	5.03
ASA_IMM_1PNPDE20091123_103140_000000592084_00294_40428_1125.N1						IS2	H/H	84	40428	294	4.07
ASA_IMM_1PNPDE20091123_103140_000001772084_00294_40428_0774.N1						IS2	H/H	84	40428	294	4.07
ASA_IMM_1PNPDE20091123_114016_000001032084_00295_40429_5651.N1						IS2	V/V	84	40429	295	5.03
ASA_IMM_1PNPDE20091123_114016_000001022084_00295_40429_0768.N1						IS2	V/V	84	40429	295	4.07
ASA_IMM_1PNPDE20091123_114016_000000632084_00295_40429_1253.N1						IS2	V/V	84	40429	295	4.07
ASA_IMM_1PNPDK20091123_120817_000004592084_00295_40429_7057.N1						IS2	H/H	84	40429	295	4.07
ASA_IMM_1PNPDE20091123_153409_000001222084_00297_40431_1344.N1						IS2	H/H	84	40431	297	4.07
ASA_IMM_1PNPDE20091123_153409_000000632084_00297_40431_0522.N1						IS2	H/H	84	40431	297	4.07
ASA_IMM_1PNPDE20091123_163758_000000372084_00298_40432_0546.N1						IS2	V/V	84	40432	298	4.07
ASA_IMM_1PNPDE20091123_163758_000000372084_00298_40432_0468.N1						IS2	V/V	84	40432	298	4.07
ASA_IMM_1PNPDE20091123_171139_000000632084_00298_40432_0526.N1						IS2	H/H	84	40432	298	4.07
ASA_IMM_1PNPDE20091123_171139_000000902084_00298_40432_0733.N1						IS2	H/H	84	40432	298	4.07
ASA_IMM_1PNPDE20091123_171359_000001612084_00298_40432_0725.N1						IS2	H/H	84	40432	298	4.07
ASA_IMM_1PNPDE20091123_171359_000001612084_00298_40432_1436.N1						IS2	H/H	84	40432	298	4.07
ASA_IMM_1PNPDE20091123_174627_000001142084_00299_40433_0681.N1						IS2	V/V	84	40433	299	4.07
ASA_IMM_1PNPDE20091123_181723_000000532084_00299_40433_5627.N1						IS2	V/V	84	40433	299	5.03
ASA_IMM_1PNPDE20091123_185144_000000902084_00299_40433_1346.N1						IS2	H/H	84	40433	299	4.07
ASA_IMM_1PNPDE20091123_185404_000003442084_00299_40433_5663.N1						IS2	H/H	84	40433	299	5.03
ASA_IMM_1PNPDE20091123_192032_000001422084_00300_40434_5500.N1						IS2	V/V	84	40434	300	5.03
ASA_IMM_1PNPDE20091123_192136_000000592084_00300_40434_1356.N1						IS2	V/V	84	40434	300	4.07
ASA_IMM_1PNPDE20091123_203519_000001922084_00300_40434_5664.N1						IS2	H/H	84	40434	300	5.03
ASA_IMM_1PNPDE20091123_203519_000001232084_00300_40434_1454.N1						IS2	H/H	84	40434	300	4.07
ASA_IMM_1PNPDE20091123_221025_000000912084_00301_40435_1293.N1						IS2	H/H	84	40435	301	4.07
ASA_IMM_1PNPDE20091123_221245_000001992084_00301_40435_1372.N1						IS2	H/H	84	40435	301	4.07
ASA_IMM_1PNPDE20091123_224712_000000532084_00302_40436_1360.N1						IS2	V/V	84	40436	302	4.07
ASA_IMM_1PNPDE20091123_235023_000001232084_00302_40436_1428.N1						IS2	H/H	84	40436	302	4.07
ASA_IMM_1PNPDE20091123_235023_000004432084_00302_40436_5494.N1						IS2	H/H	84	40436	302	5.03
ASA_IMM_1PNPDE20091123_235327_000000592084_00302_40436_1414.N1						IS2	H/H	84	40436	302	4.07


Filename	Pol	Timestamp	count(Module)		
ASA_MS__0PNPDE20091123_015915_000000162084_00289_40423_0477.N1	H	2009-11-23 01:59:15	320		
ASA_MS__0PNPDK20091123_084139_000000162084_00293_40427_0921.N1	V	2009-11-23 08:41:39	320		

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WSM_1PNPDE20091123_002004_000001042084_00288_40422_5594.N1						SS1	H/H	84	40422	288	5.03
ASA_WSM_1PNPDE20091123_003001_000003362084_00288_40422_0756.N1						SS1	H/H	84	40422	288	4.07
ASA_WSM_1PNPDE20091123_003001_000001352084_00288_40422_0715.N1						SS1	H/H	84	40422	288	4.07
ASA_WSM_1PNPDE20091123_003115_000000612084_00288_40422_0574.N1						SS1	H/H	84	40422	288	4.07
ASA_WSM_1PNPDE20091123_003311_000000612084_00288_40422_0450.N1						SS1	H/H	84	40422	288	4.07
ASA_WSM_1PNPDE20091123_003311_000000612084_00288_40422_0578.N1						SS1	H/H	84	40422	288	4.07
ASA_WSM_1PNPDE20091123_003513_000000242084_00288_40422_0454.N1						SS1	H/H	84	40422	288	4.07
ASA_WSM_1PNPDE20091123_010813_000002512084_00289_40423_0155.N1						SS1	H/H	84	40423	289	4.07
ASA_WSM_1PNPDE20091123_010813_000004092084_00289_40423_0396.N1						SS1	H/H	84	40423	289	4.07
ASA_WSM_1PNPDE20091123_011325_000000962084_00289_40423_0156.N1						SS1	H/H	84	40423	289	4.07
ASA_WSM_1PNPDE20091123_020106_000001352084_00289_40423_0113.N1						SS1	H/H	84	40423	289	4.07
ASA_WSM_1PNPDE20091123_021024_000001352084_00289_40423_0105.N1						SS1	H/H	84	40423	289	4.07
ASA_WSM_1PNPDE20091123_021024_000001832084_00289_40423_0201.N1						SS1	H/H	84	40423	289	4.07
ASA_WSM_1PNPDE20091123_024016_000002142084_00290_40424_0359.N1						SS1	V/V	84	40424	290	4.07
ASA_WSM_1PNPDE20091123_024130_000001152084_00290_40424_0159.N1						SS1	V/V	84	40424	290	4.07
ASA_WSM_1PNPDE20091123_033900_000002692084_00290_40424_0398.N1						SS1	H/H	84	40424	290	4.07
ASA_WSM_1PNPDE20091123_033900_000000732084_00290_40424_0083.N1						SS1	H/H	84	40424	290	4.07
ASA_WSM_1PNPDE20091123_034210_000000782084_00290_40424_0231.N1						SS1	H/H	84	40424	290	4.07
ASA_WSM_1PNPDE20091123_034921_000003302084_00290_40424_0189.N1						SS1	H/H	84	40424	290	4.07
ASA_WSM_1PNPDE20091123_052007_000000732084_00291_40425_0119.N1						SS1	H/H	84	40425	291	4.07
ASA_WSM_1PNPDE20091123_052007_000002752084_00291_40425_0598.N1						SS1	H/H	84	40425	291	4.07
ASA_WSM_1PNPDE20091123_052222_000001162084_00291_40425_0217.N1						SS1	H/H	84	40425	291	4.07
ASA_WSM_1PNPDK20091123_062049_000003732084_00292_40426_7046.N1						SS1	H/H	84	40426	292	4.07
ASA_WSM_1PNPDE20091123_065953_000001352084_00292_40426_0695.N1						SS1	H/H	84	40426	292	4.07
ASA_WSM_1PNPDE20091123_065953_000003302084_00292_40426_0535.N1						SS1	H/H	84	40426	292	4.07
ASA_WSM_1PNPDE20091123_070107_000002552084_00292_40426_0249.N1						SS1	H/H	84	40426	292	4.07
ASA_WSM_1PNPDE20091123_070404_000000782084_00292_40426_0696.N1						SS1	H/H	84	40426	292	4.07
ASA_WSM_1PNPDK20091123_080641_000000972084_00293_40427_6920.N1						SS1	H/H	84	40427	293	4.07
ASA_WSM_1PNPDK20091123_084429_000000922084_00293_40427_6961.N1						SS1	H/H	84	40427	293	4.07
ASA_WSM_1PNPDK20091123_094157_000002512084_00294_40428_6965.N1						SS1	H/H	84	40428	294	4.07
ASA_WSM_1PNPDK20091123_094845_000001212084_00294_40428_6963.N1						SS1	V/V	84	40428	294	4.07
ASA_WSM_1PNPDE20091123_102100_000002142084_00294_40428_0394.N1						SS1	H/H	84	40428	294	4.07
ASA_WSM_1PNPDE20091123_102315_000000792084_00294_40428_0836.N1						SS1	H/H	84	40428	294	4.07
ASA_WSM_1PNPDE20091123_102502_000000912084_00294_40428_0454.N1						SS1	H/H	84	40428	294	4.07
ASA_WSM_1PNPDE20091123_102615_000000182084_00294_40428_0109.N1						SS1	H/H	84	40428	294	4.07
ASA_WSM_1PNPDE20091123_102703_000000732084_00294_40428_0115.N1						SS1	H/H	84	40428	294	4.07
ASA_WSM_1PNPDE20091123_102703_000000912084_00294_40428_0416.N1						SS1	H/H	84	40428	294	4.07
ASA_WSM_1PNPDE20091123_102703_000000912084_00294_40428_0776.N1						SS1	H/H	84	40428	294	4.07
ASA_WSM_1PNPDK20091123_112201_000004152084_00295_40429_6998.N1						SS1	H/H	84	40429	295	4.07
ASA_WSM_1PNPDE20091123_120222_000003542084_00295_40429_0814.N1						SS1	H/H	84	40429	295	4.07
ASA_WSM_1PNPDE20091123_120222_000003542084_00295_40429_0570.N1						SS1	H/H	84	40429	295	4.07
ASA_WSM_1PNPDE20091123_120336_000002382084_00295_40429_0414.N1						SS1	H/H	84	40429	295	4.07
ASA_WSM_1PNPDK20091123_130612_000001892084_00296_40430_7059.N1						SS1	H/H	84	40430	296	4.07
ASA_WSM_1PNPDE20091123_134443_000002502084_00296_40430_0751.N1						SS1	H/H	84	40430	296	4.07
ASA_WSM_1PNPDE20091123_134556_000001962084_00296_40430_0782.N1						SS1	H/H	84	40430	296	4.07
ASA_WSM_1PNPDK20091123_143640_000001892084_00297_40431_7103.N1						SS1	H/H	84	40431	297	4.07
ASA_WSM_1PNPDK20091123_144206_000002752084_00297_40431_7105.N1						SS1	H/H	84	40431	297	4.07
ASA_WSM_1PNPDE20091123_144706_000001702084_00297_40431_0307.N1						SS1	H/H	84	40431	297	4.07
ASA_WSM_1PNPDE20091123_152532_000002682084_00297_40431_0630.N1						SS1	H/H	84	40431	297	4.07
ASA_WSM_1PNPDE20091123_152532_000001342084_00297_40431_0317.N1						SS1	H/H	84	40431	297	4.07
ASA_WSM_1PNPDE20091123_152841_000000782084_00297_40431_0690.N1						SS1	H/H	84	40431	297	4.07
ASA_WSM_1PNPDE20091123_152942_000000182084_00297_40431_0199.N1						SS1	H/H	84	40431	297	4.07
ASA_WSM_1PNPDK20091123_161513_000003112084_00298_40432_7152.N1						SS1	H/H	84	40432	298	4.07
ASA_WSM_1PNPDK20091123_162110_000001892084_00298_40432_7154.N1						SS1	H/H	84	40432	298	4.07
ASA_WSM_1PNPDE20091123_162613_000000922084_00298_40432_0489.N1						SS1	H/H	84	40432	298	4.07
ASA_WSM_1PNPDE20091123_162727_000000182084_00298_40432_0556.N1						SS1	H/H	84	40432	298	4.07
ASA_WSM_1PNPDE20091123_162727_000000182084_00298_40432_0472.N1						SS1	H/H	84	40432	298	4.07
ASA_WSM_1PNPDE20091123_162727_000000182084_00298_40432_0220.N1						SS1	H/H	84	40432	298	4.07
ASA_WSM_1PNPDE20091123_170525_000002502084_00298_40432_0683.N1						SS1	H/H	84	40432	298	4.07
ASA_WSM_1PNPDE20091123_170834_000001412084_00298_40432_0746.N1						SS1	H/H	84	40432	298	4.07
ASA_WSM_1PNPDE20091123_171037_000000182084_00298_40432_0496.N1						SS1	H/H	84	40432	298	4.07
ASA_WSM_1PNPDE20091123_171728_000001522084_00298_40432_0559.N1						SS1	H/H	84	40432	298	4.07
ASA_WSM_1PNPDE20091123_171841_000000612084_00298_40432_0253.N1						SS1	H/H	84	40432	298	4.07
ASA_WSM_1PNPDE20091123_171841_000000782084_00298_40432_0688.N1						SS1	H/H	84	40432	298	4.07
ASA_WSM_1PNPDK20091123_175653_000002132084_00299_40433_7189.N1						SS1	H/H	84	40433	299	4.07
ASA_WSM_1PNPDK20091123_180114_000001902084_00299_40433_7191.N1						SS1	H/H	84	40433	299	4.07
ASA_WSM_1PNPDE20091123_184531_000000732084_00299_40433_0289.N1						SS1	H/H	84	40433	299	4.07


ASA_WSM_1PNPDE20091123_184531_000003302084_00299_40433_0673.N1	SS1	H/H	84	40433	299	4.07
ASA_WSM_1PNPDE20091123_184942_000000782084_00299_40433_0602.N1	SS1	H/H	84	40433	299	4.07
ASA_WSM_1PNPDK20091123_193501_000001342084_00300_40434_7229.N1	SS1	H/H	84	40434	300	4.07
ASA_WSM_1PNPDK20091123_193748_000003122084_00300_40434_7231.N1	SS1	H/H	84	40434	300	4.07
ASA_WSM_1PNPDE20091123_202642_000002142084_00300_40434_0618.N1	SS1	H/H	84	40434	300	4.07
ASA_WSM_1PNPDE20091123_202642_000000732084_00300_40434_0309.N1	SS1	H/H	84	40434	300	4.07
ASA_WSM_1PNPDE20091123_202642_000000732084_00300_40434_0223.N1	SS1	H/H	84	40434	300	4.07
ASA_WSM_1PNPDE20091123_202642_000002142084_00300_40434_0724.N1	SS1	H/H	84	40434	300	4.07
ASA_WSM_1PNPDE20091123_202857_000000552084_00300_40434_0313.N1	SS1	H/H	84	40434	300	4.07
ASA_WSM_1PNPDE20091123_202857_000000792084_00300_40434_0484.N1	SS1	H/H	84	40434	300	4.07
ASA_WSM_1PNPDE20091123_203908_000001532084_00300_40434_0596.N1	SS1	H/H	84	40434	300	4.07
ASA_WSM_1PNPDE20091123_203908_000001532084_00300_40434_0826.N1	SS1	H/H	84	40434	300	4.07
ASA_WSM_1PNPDE20091123_204123_000000182084_00300_40434_0305.N1	SS1	H/H	84	40434	300	4.07
ASA_WSM_1PNPDE20091123_204644_000002132084_00300_40434_0677.N1	SS1	V/V	84	40434	300	4.07
ASA_WSM_1PNPDE20091123_204644_000002132084_00300_40434_0632.N1	SS1	V/V	84	40434	300	4.07
ASA_WSM_1PNPDE20091123_204757_000001152084_00300_40434_0503.N1	SS1	V/V	84	40434	300	4.07
ASA_WSM_1PNPDE20091123_204858_000000552084_00300_40434_0331.N1	SS1	V/V	84	40434	300	4.07
ASA_WSM_1PNPDK20091123_211121_000003052084_00301_40435_7251.N1	SS1	V/V	84	40435	301	4.07
ASA_WSM_1PNPDK20091123_211926_000001702084_00301_40435_7249.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_213000_000001522084_00301_40435_0620.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_213000_000000732084_00301_40435_0257.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_213000_000000732084_00301_40435_0321.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_213000_000001522084_00301_40435_0736.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_213214_000000182084_00301_40435_0261.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_220633_000002142084_00301_40435_0696.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_220633_000000732084_00301_40435_0335.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_220633_000002142084_00301_40435_0675.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_220633_000001902084_00301_40435_0662.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_220848_000000792084_00301_40435_0636.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_221923_000002752084_00301_40435_0664.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_221923_000000732084_00301_40435_0279.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_221923_000002752084_00301_40435_0634.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_221923_000000732084_00301_40435_0345.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_222138_000000552084_00301_40435_0283.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_222233_000000842084_00301_40435_0600.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDE20091123_222334_000000242084_00301_40435_0287.N1	SS1	H/H	84	40435	301	4.07
ASA_WSM_1PNPDK20091123_225755_000001902084_00302_40436_7259.N1	SS1	H/H	84	40436	302	4.07
ASA_WSM_1PNPDE20091123_234715_000001832084_00302_40436_0658.N1	SS1	H/H	84	40436	302	4.07
ASA_WSM_1PNPDE20091123_234829_000000612084_00302_40436_0369.N1	SS1	H/H	84	40436	302	4.07
ASA_WSM_1PNPDE20091123_235827_000000912084_00302_40436_0660.N1	SS1	H/H	84	40436	302	4.07
ASA_WSM_1PNPDE20091123_235940_000000182084_00302_40436_0357.N1	SS1	H/H	84	40436	302	4.07


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20091122_234722_000009892084_00288_40422_5482.N1						IS2	V/V	84	40422	288	5.03
ASA_WVS_1PNPDE20091123_001139_000003752084_00288_40422_1208.N1						IS2	V/V	84	40422	288	4.07
ASA_WVS_1PNPDE20091123_003534_000002842084_00288_40422_0391.N1						IS2	V/V	84	40422	288	4.07
ASA_WVS_1PNPDE20091123_003919_000004942084_00288_40422_5486.N1						IS2	V/V	84	40422	288	5.03
ASA_WVS_1PNPDE20091123_003534_000002842084_00288_40422_0391.N1						IS1	V/V	84	40422	288	4.07
ASA_WVS_1PNPDE20091123_005104_000009592084_00288_40422_5484.N1						IS2	V/V	84	40422	288	5.03
ASA_WVS_1PNPDE20091123_013622_000006592084_00289_40423_5502.N1						IS2	V/V	84	40423	289	5.03
ASA_WVS_1PNPDE20091123_015048_000004652084_00289_40423_1223.N1						IS2	V/V	84	40423	289	4.07
ASA_WVS_1PNPDE20091123_021521_000001352084_00289_40423_5510.N1						IS2	V/V	84	40423	289	5.03
ASA_WVS_1PNPDE20091123_021651_000002852084_00289_40423_5509.N1						IS2	V/V	84	40423	289	5.03
ASA_WVS_1PNPDE20091123_023531_000002392084_00290_40424_5508.N1						IS2	V/V	84	40424	290	5.03
ASA_WVS_1PNPDE20091123_031901_000008242084_00290_40424_5505.N1						IS2	V/V	84	40424	290	5.03
ASA_WVS_1PNPDE20091123_033215_000002552084_00290_40424_1220.N1						IS2	V/V	84	40424	290	4.07
ASA_WVS_1PNPDE20091123_031901_000008242084_00290_40424_5505.N1						IS1	V/V	84	40424	290	5.03
ASA_WVS_1PNPDE20091123_040023_000009442084_00290_40424_5543.N1						IS2	V/V	84	40424	290	5.03
ASA_WVS_1PNPDE20091123_041822_000000742084_00291_40425_1233.N1						IS2	V/V	84	40425	291	4.07
ASA_WVS_1PNPDE20091123_045951_000009142084_00291_40425_1245.N1						IS2	V/V	84	40425	291	4.07
ASA_WVS_1PNPDE20091123_051436_000002852084_00291_40425_0406.N1						IS2	V/V	84	40425	291	4.07
ASA_WVS_1PNPDE20091123_045951_000009142084_00291_40425_1245.N1						IS1	V/V	84	40425	291	4.07
ASA_WVS_1PNPDE20091123_053633_000015442084_00291_40425_0413.N1						IS2	V/V	84	40425	291	4.07
ASA_WVS_1PNPDE20091123_064403_000006442084_00292_40426_5539.N1						IS2	V/V	84	40426	292	5.03
ASA_WVS_1PNPDK20091123_065433_000002702084_00292_40426_6886.N1						IS2	V/V	84	40426	292	4.07
ASA_WVS_1PNPDE20091123_064403_000006442084_00292_40426_5539.N1						IS1	V/V	84	40426	292	5.03
ASA_WVS_1PNPDK20091123_071709_000019042084_00292_40426_6893.N1						IS2	V/V	84	40426	292	4.07
ASA_WVS_1PNPDK20091123_083220_000005252084_00293_40427_6931.N1						IS2	V/V	84	40427	293	4.07
ASA_WVS_1PNPDK20091123_085745_000020242084_00293_40427_6942.N1						IS2	V/V	84	40427	293	4.07
ASA_WVS_1PNPDK20091123_100408_000009742084_00294_40428_6972.N1						IS2	V/V	84	40428	294	4.07
ASA_WVS_1PNPDK20091123_103821_000018442084_00294_40428_6979.N1						IS2	V/V	84	40428	294	4.07
ASA_WVS_1PNPDK20091123_112855_000006442084_00295_40429_7013.N1						IS2	V/V	84	40429	295	4.07
ASA_WVS_1PNPDK20091123_114205_000011692084_00295_40429_7018.N1						IS2	V/V	84	40429	295	4.07
ASA_WVS_1PNPDK20091123_121857_000004052084_00295_40429_7021.N1						IS2	V/V	84	40429	295	4.07
ASA_WVS_1PNPDK20091123_123030_000010212084_00295_40429_7026.N1						IS2	V/V	84	40429	295	4.07
ASA_WVS_1PNPDK20091123_130939_000008692084_00296_40430_7070.N1						IS2	V/V	84	40430	296	4.07
ASA_WVS_1PNPDK20091123_135933_000004202084_00296_40430_7073.N1						IS2	V/V	84	40430	296	4.07
ASA_WVS_1PNPDK20091123_141206_000005242084_00296_40430_7082.N1						IS2	V/V	84	40430	296	4.07
ASA_WVS_1PNPDK20091123_145556_000005842084_00297_40431_7112.N1						IS2	V/V	84	40431	297	4.07
ASA_WVS_1PNPDK20091123_150856_000008692084_00297_40431_7121.N1						IS2	V/V	84	40431	297	4.07
ASA_WVS_1PNPDK20091123_154009_000013342084_00297_40431_7128.N1						IS2	V/V	84	40431	297	4.07
ASA_WVS_1PNPDK20091123_164255_000012592084_00298_40432_7161.N1						IS2	V/V	84	40432	298	4.07
ASA_WVS_1PNPDK20091123_172036_000014092084_00298_40432_7170.N1						IS2	V/V	84	40432	298	4.07
ASA_WVS_1PNPDK20091123_181822_000015742084_00299_40433_7198.N1						IS2	V/V	84	40433	299	4.07
ASA_WVS_1PNPDK20091123_190121_000000602084_00299_40433_7203.N1						IS2	V/V	84	40433	299	4.07
ASA_WVS_1PNPDK20091123_190453_000007642084_00299_40433_7210.N1						IS2	V/V	84	40433	299	4.07
ASA_WVS_1PNPDE20091123_195216_000019792084_00300_40434_1251.N1						IS2	V/V	84	40434	300	4.07
ASA_WVS_1PNPDE20091123_204148_000002402084_00300_40434_0700.N1						IS2	V/V	84	40434	300	4.07
ASA_WVS_1PNPDE20091123_213236_000019942084_00301_40435_5538.N1						IS2	V/V	84	40435	301	5.03
ASA_WVS_1PNPDE20091123_222355_000002852084_00301_40435_1304.N1						IS2	V/V	84	40435	301	4.07
ASA_WVS_1PNPDE20091123_222755_000007192084_00301_40435_1307.N1						IS2	V/V	84	40435	301	4.07
ASA_WVS_1PNPDE20091123_224811_000005252084_00302_40436_1299.N1						IS2	V/V	84	40436	302	4.07
ASA_WVS_1PNPDE20091123_231314_000013042084_00302_40436_1327.N1						IS2	V/V	84	40436	302	4.07
ASA_WVS_1PNPDE20091123_234111_000003152084_00302_40436_5537.N1						IS2	V/V	84	40436	302	5.03



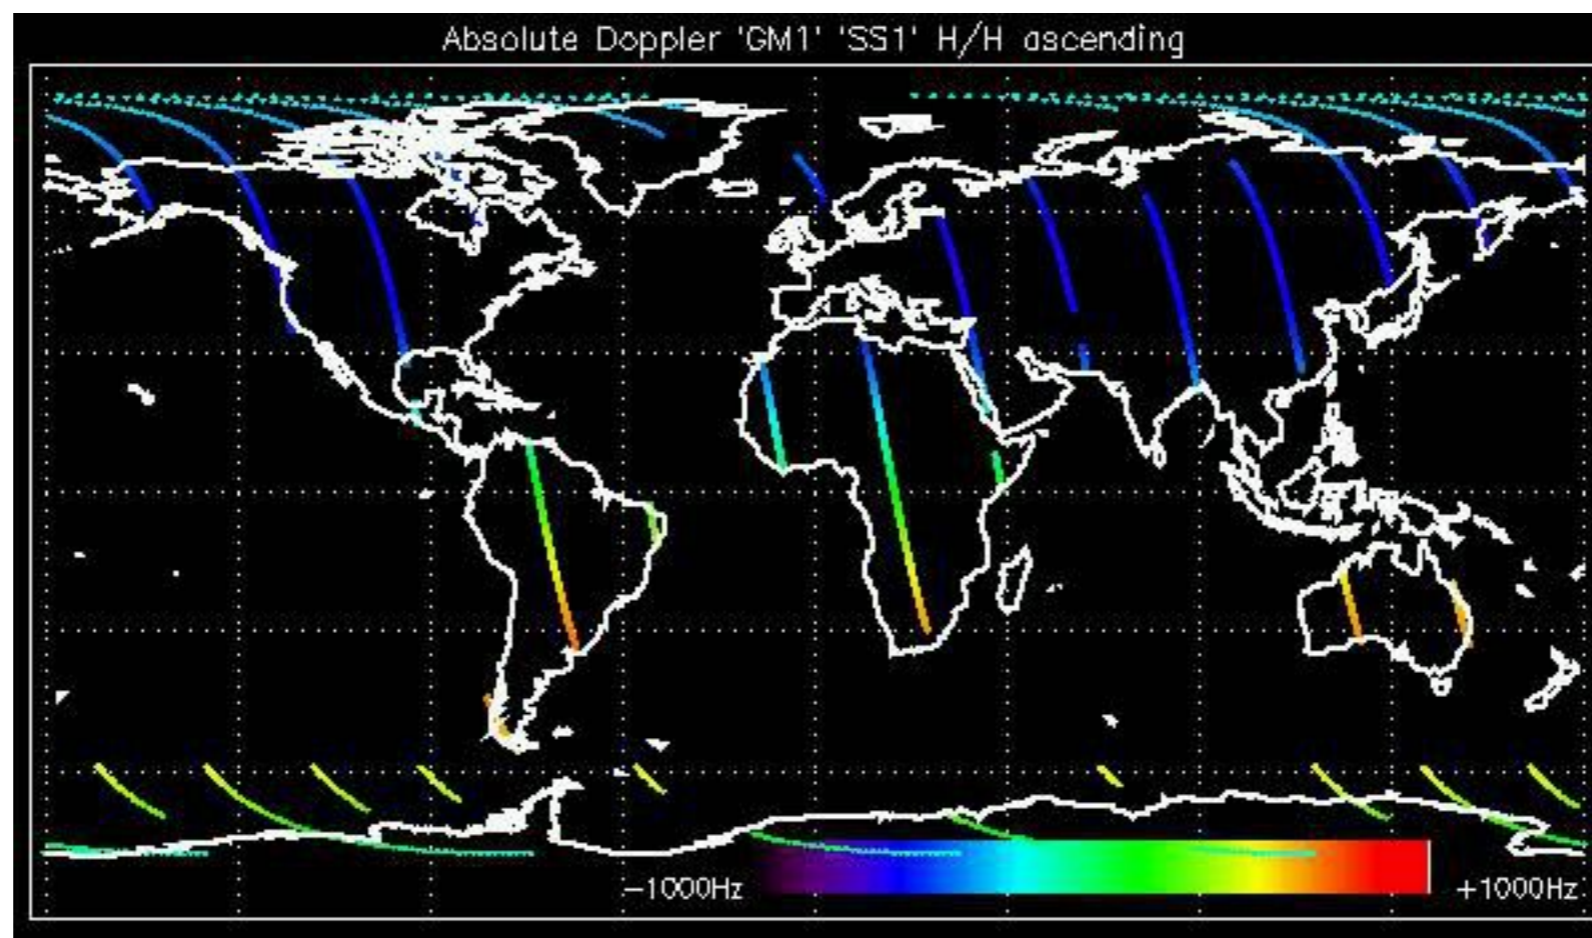




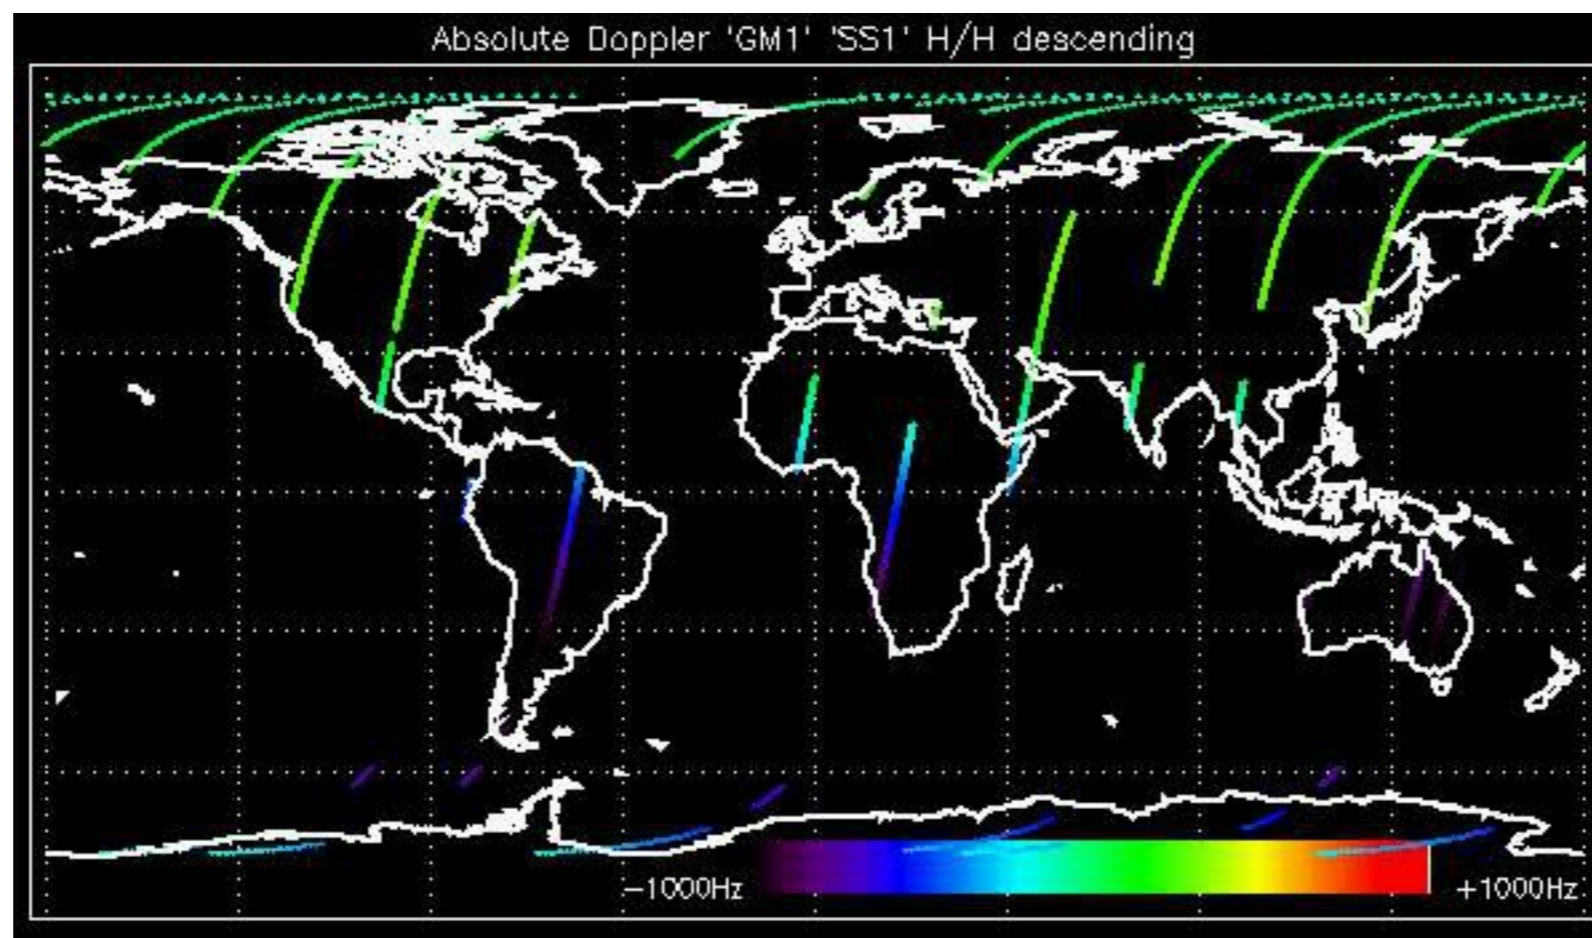





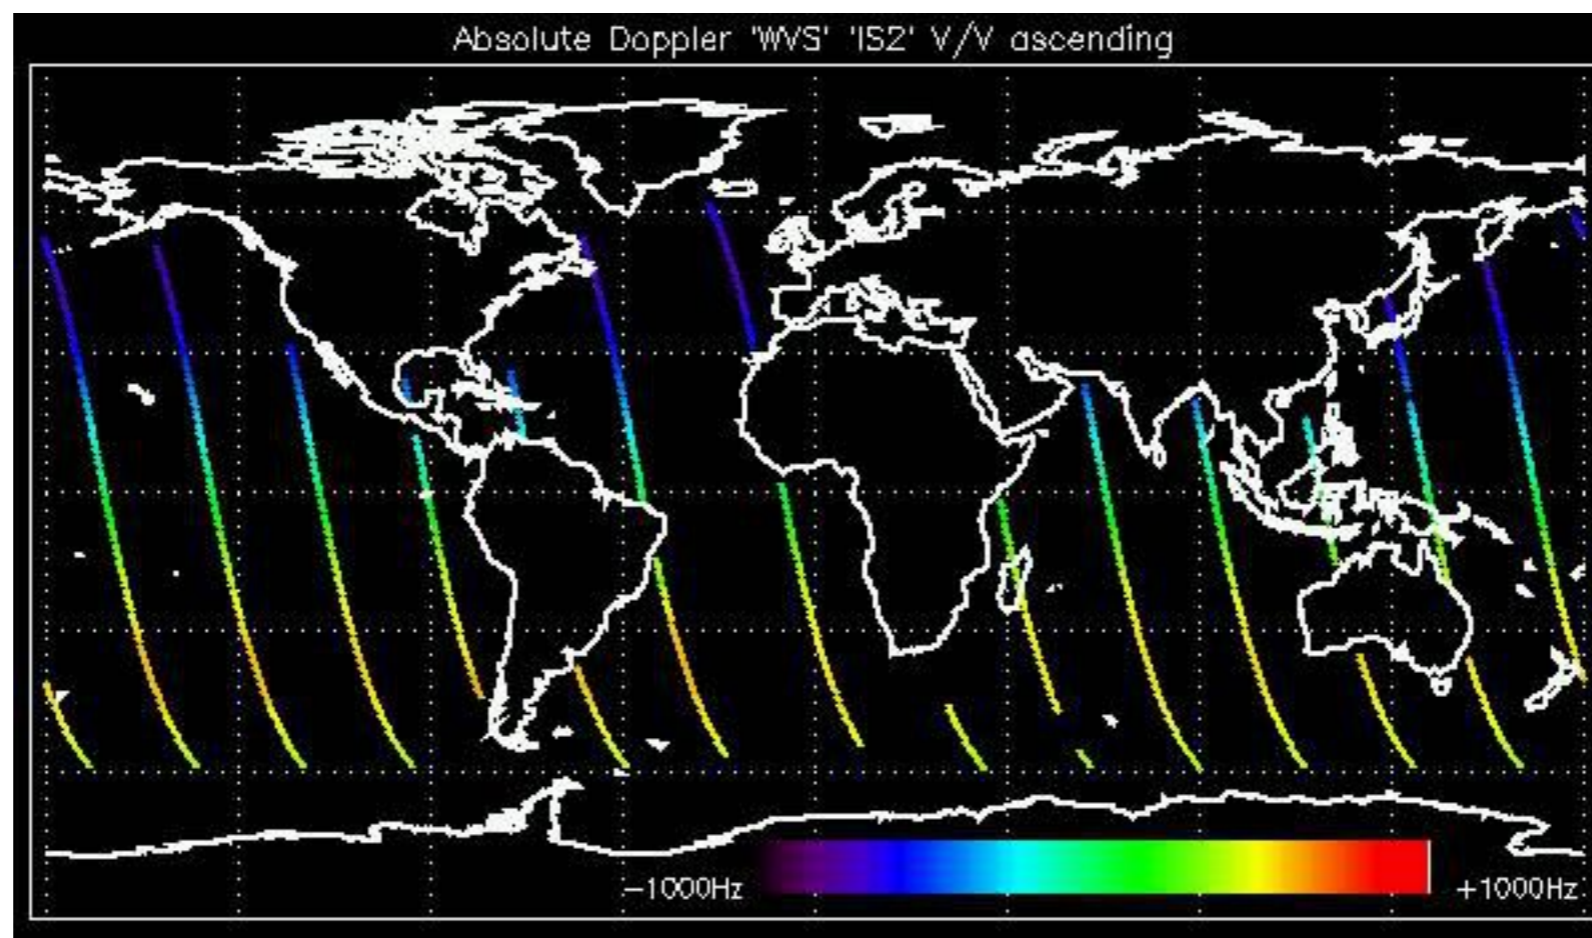


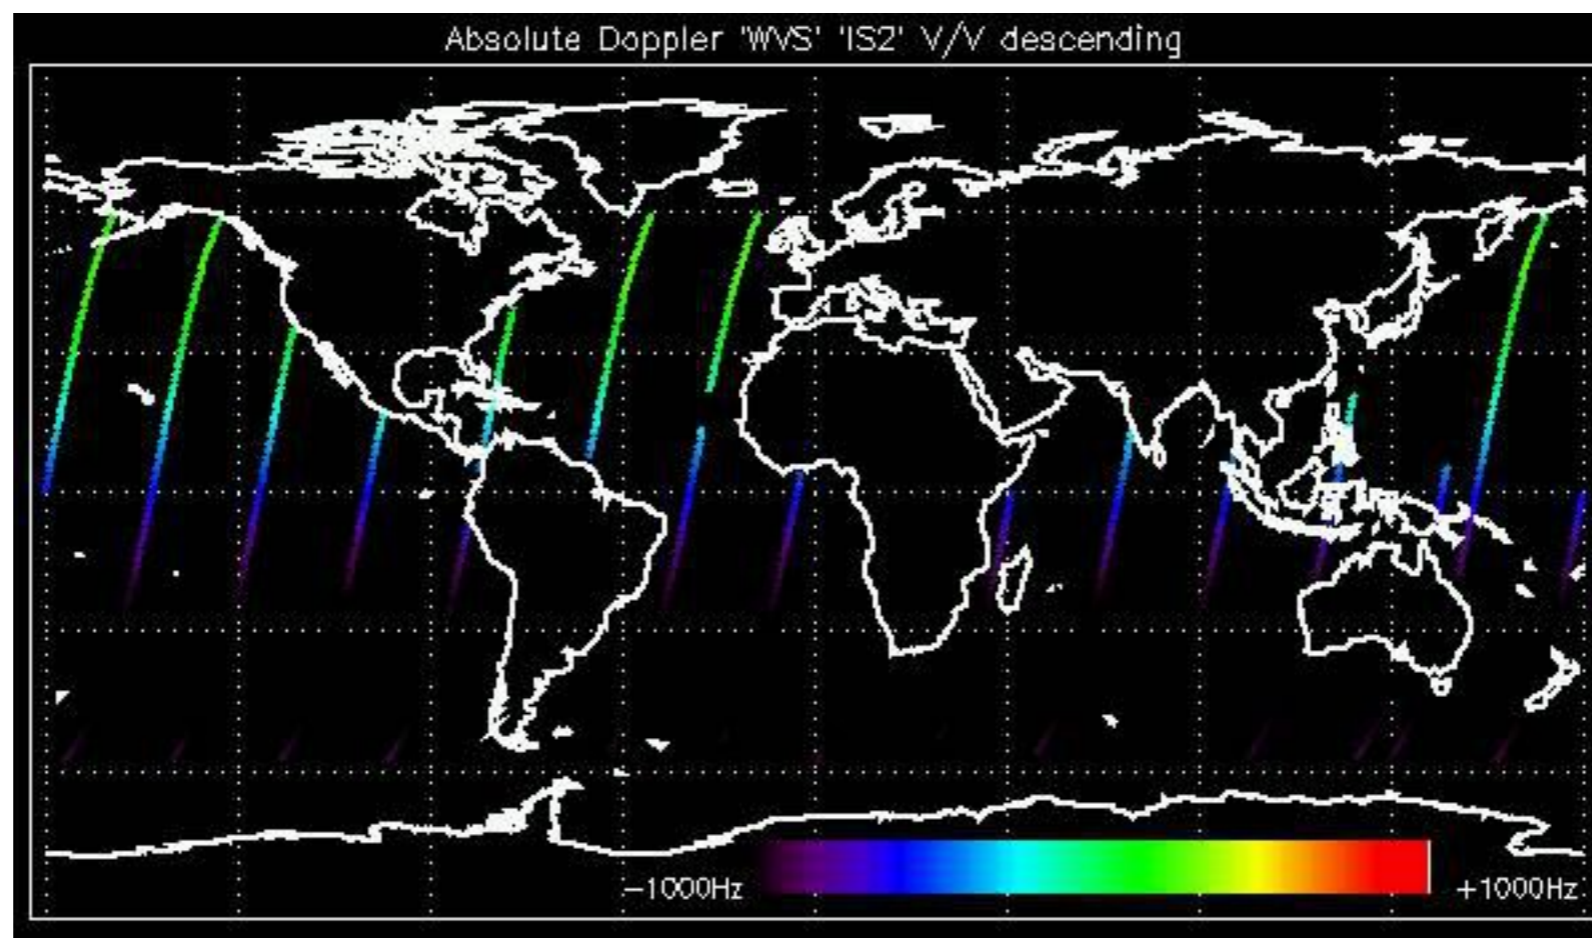


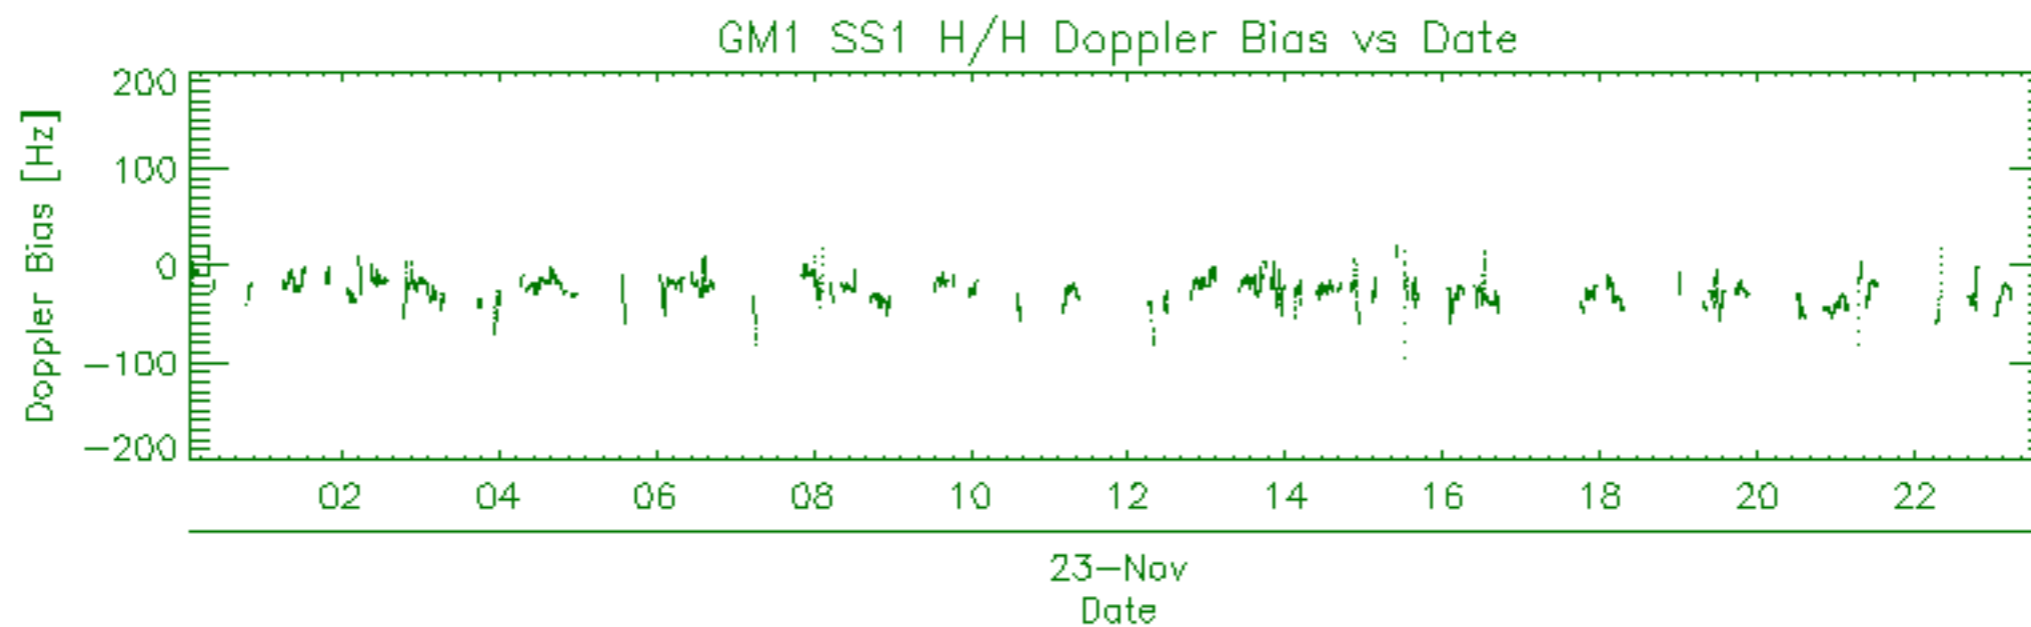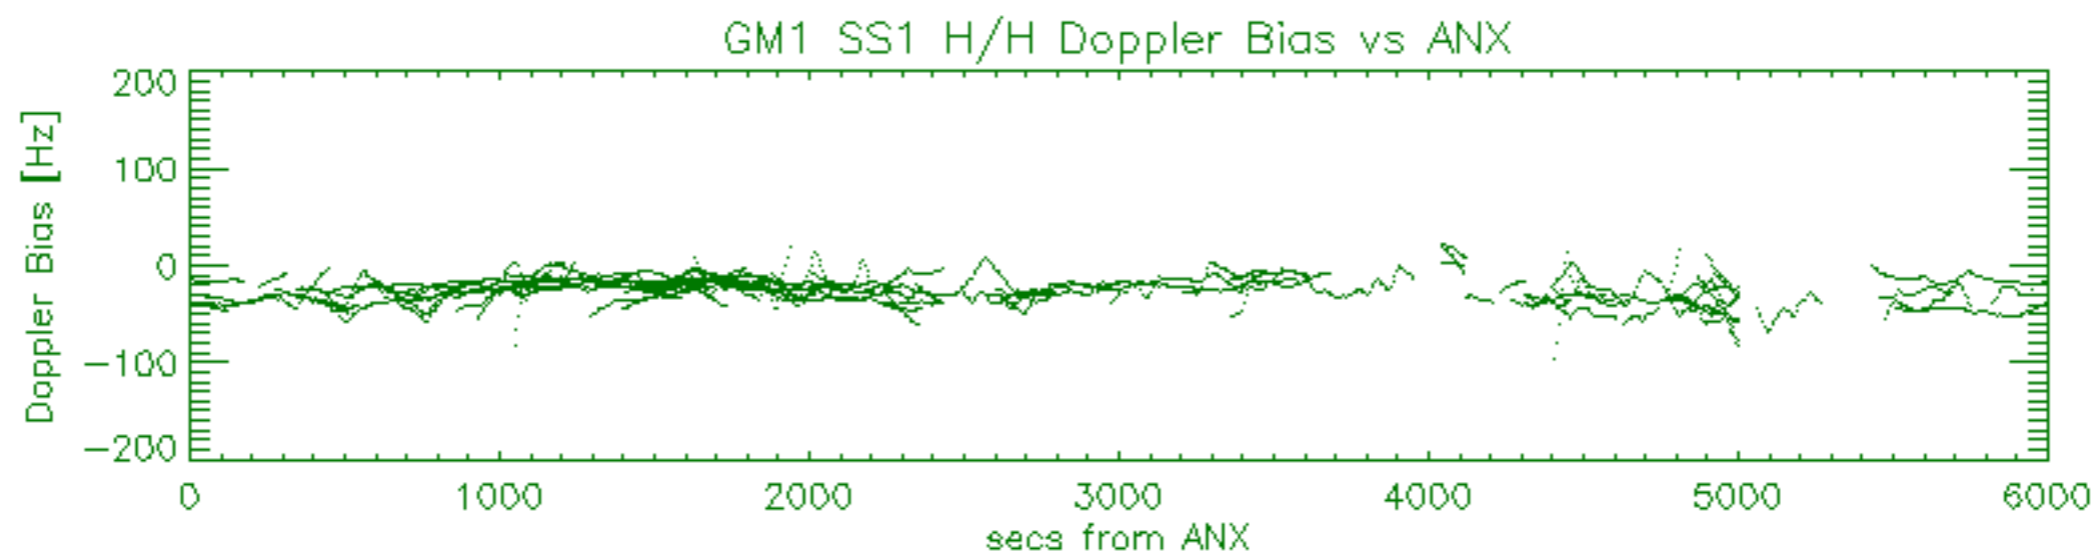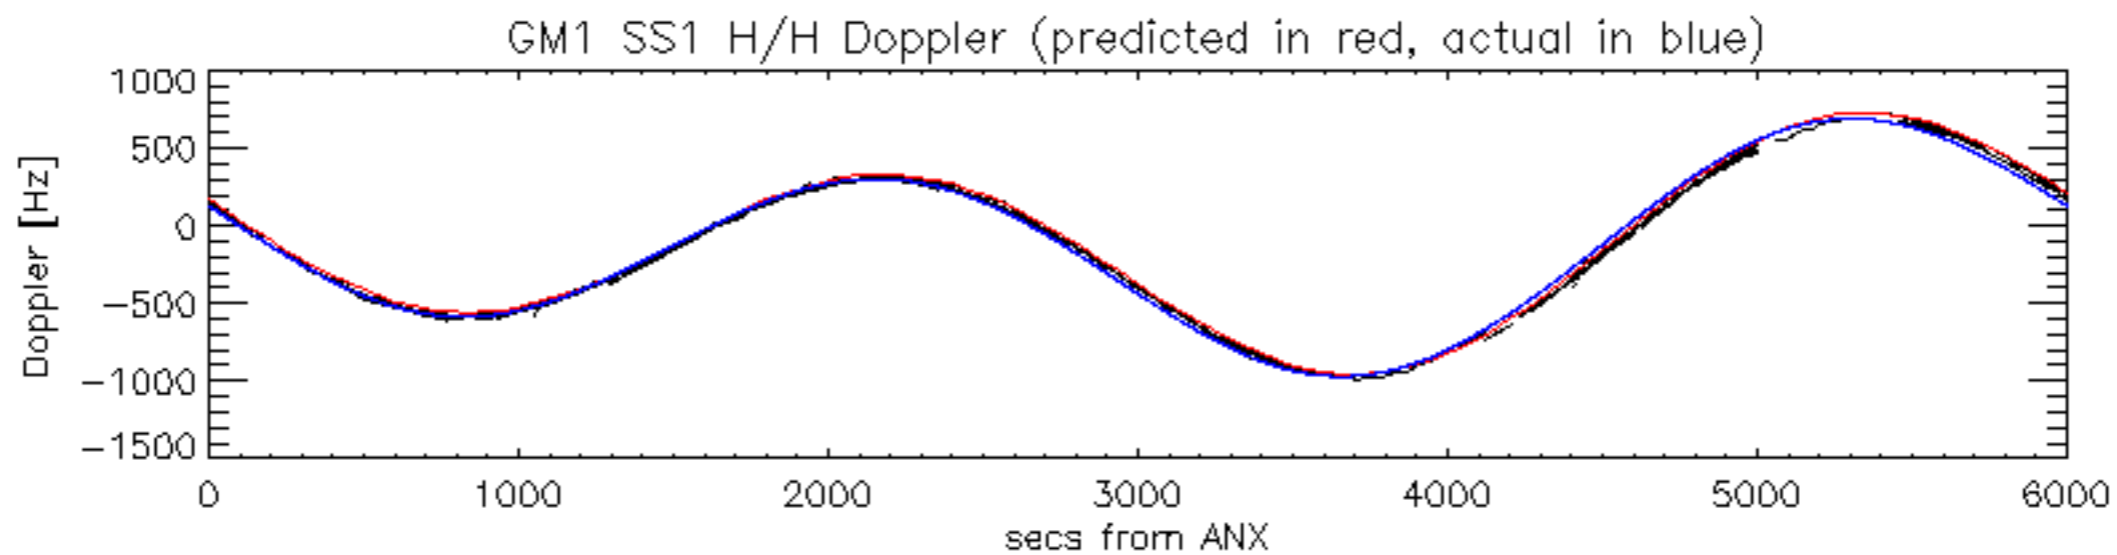


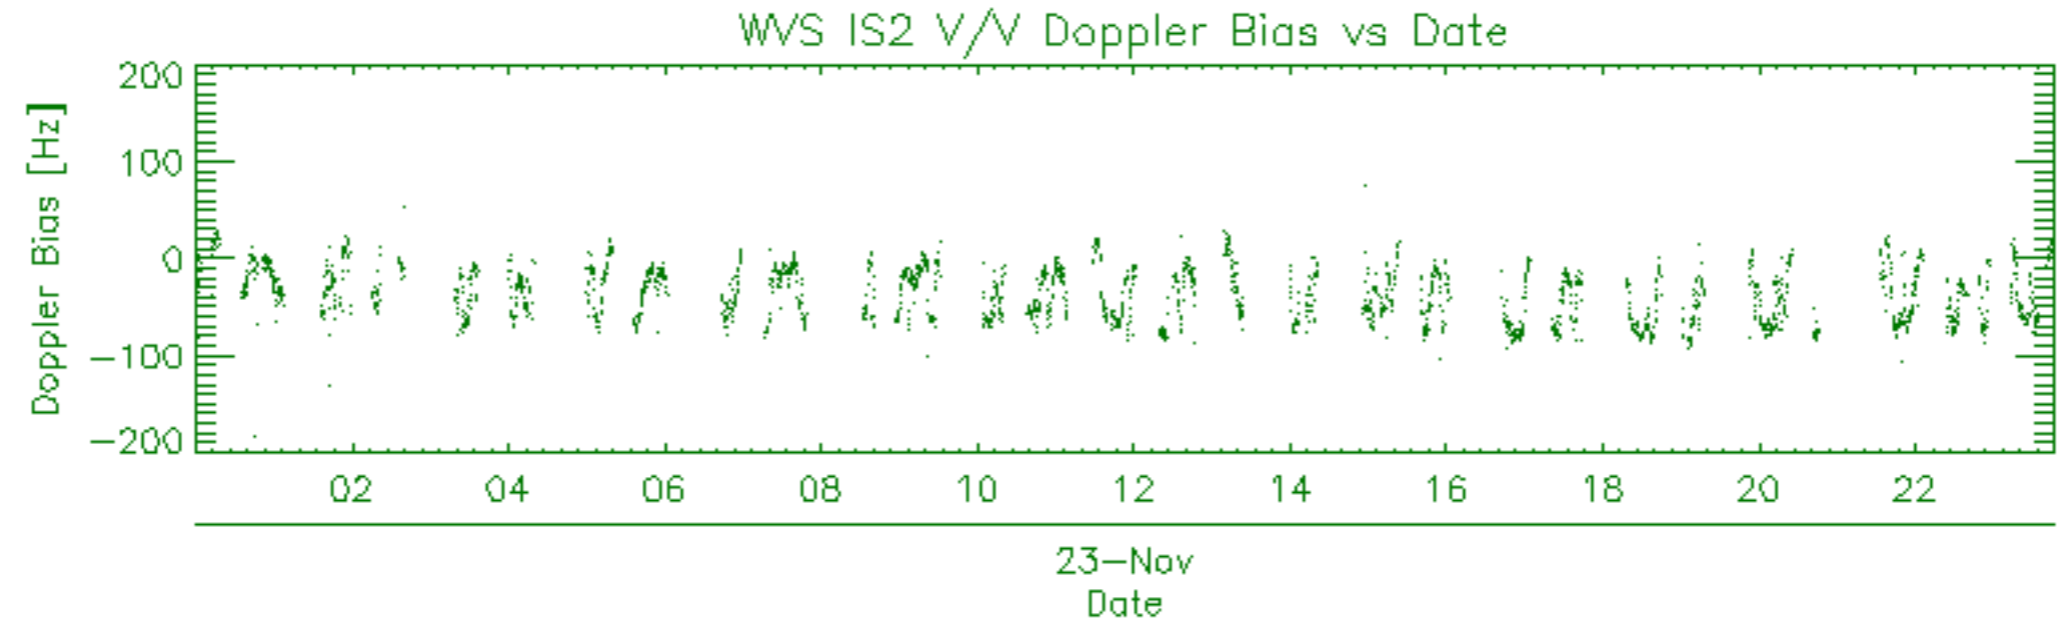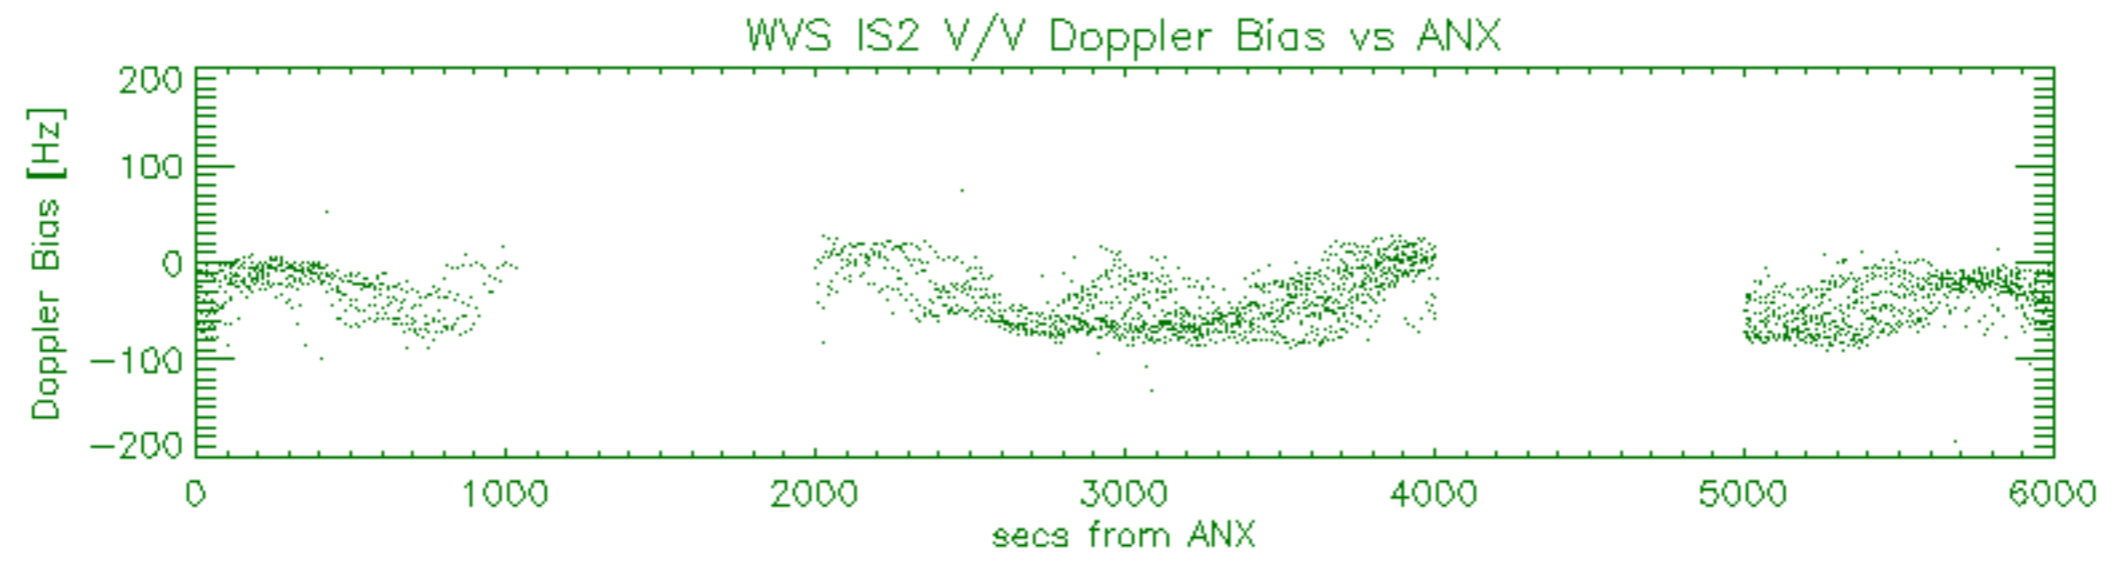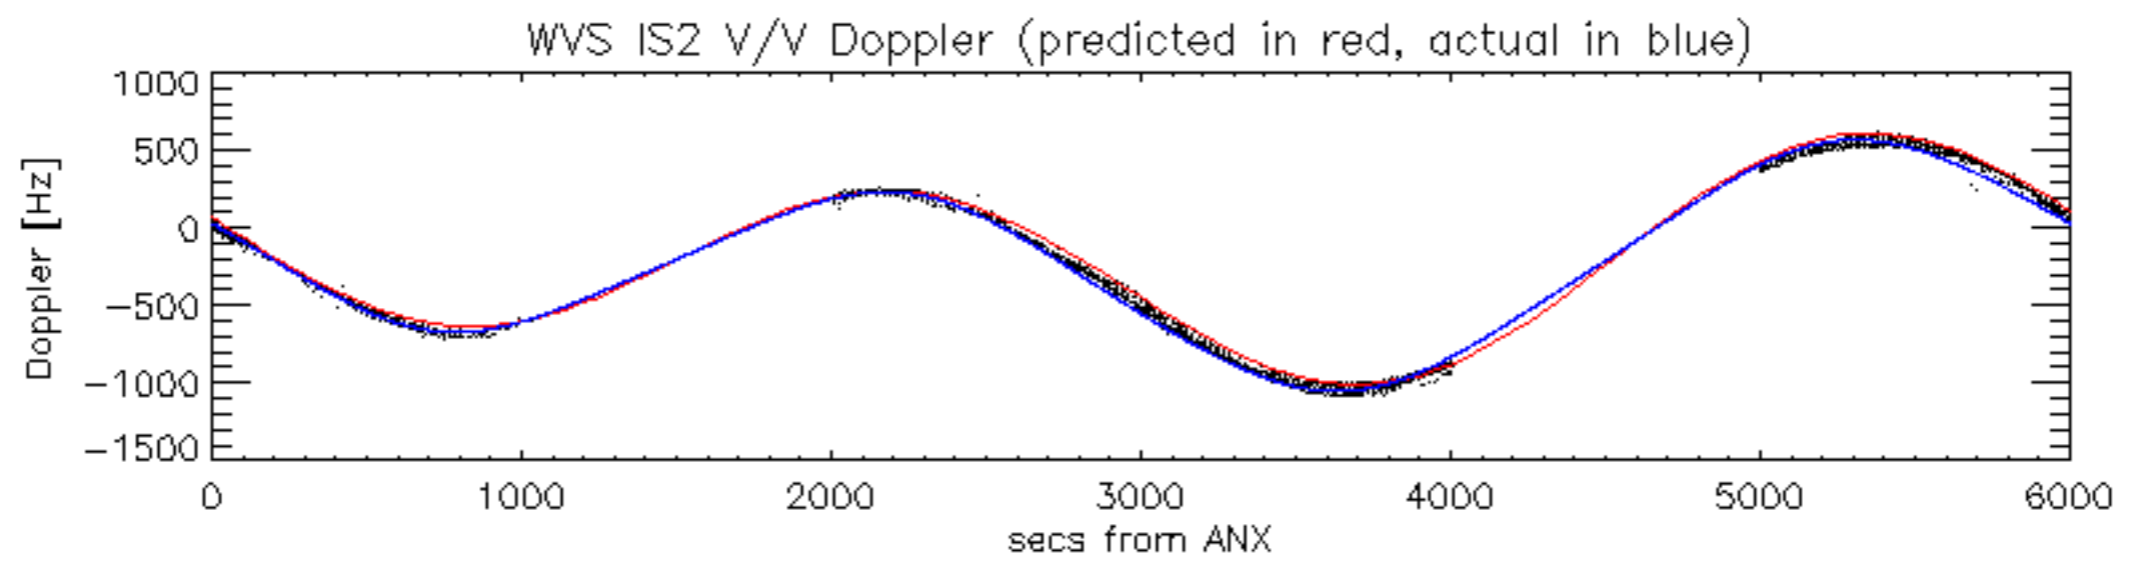




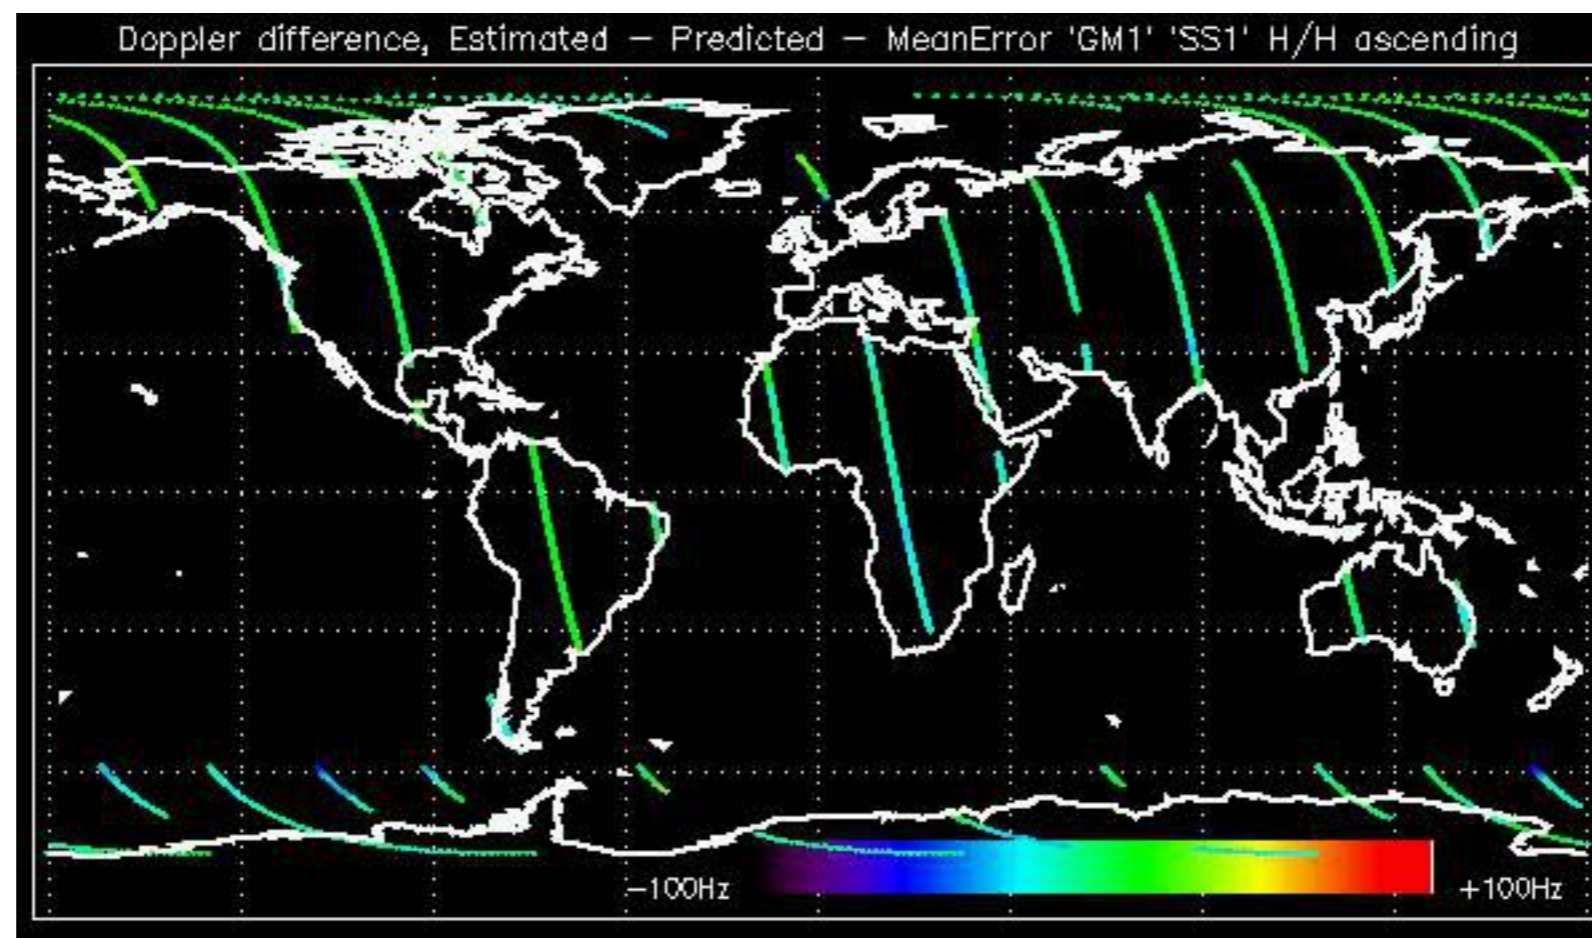


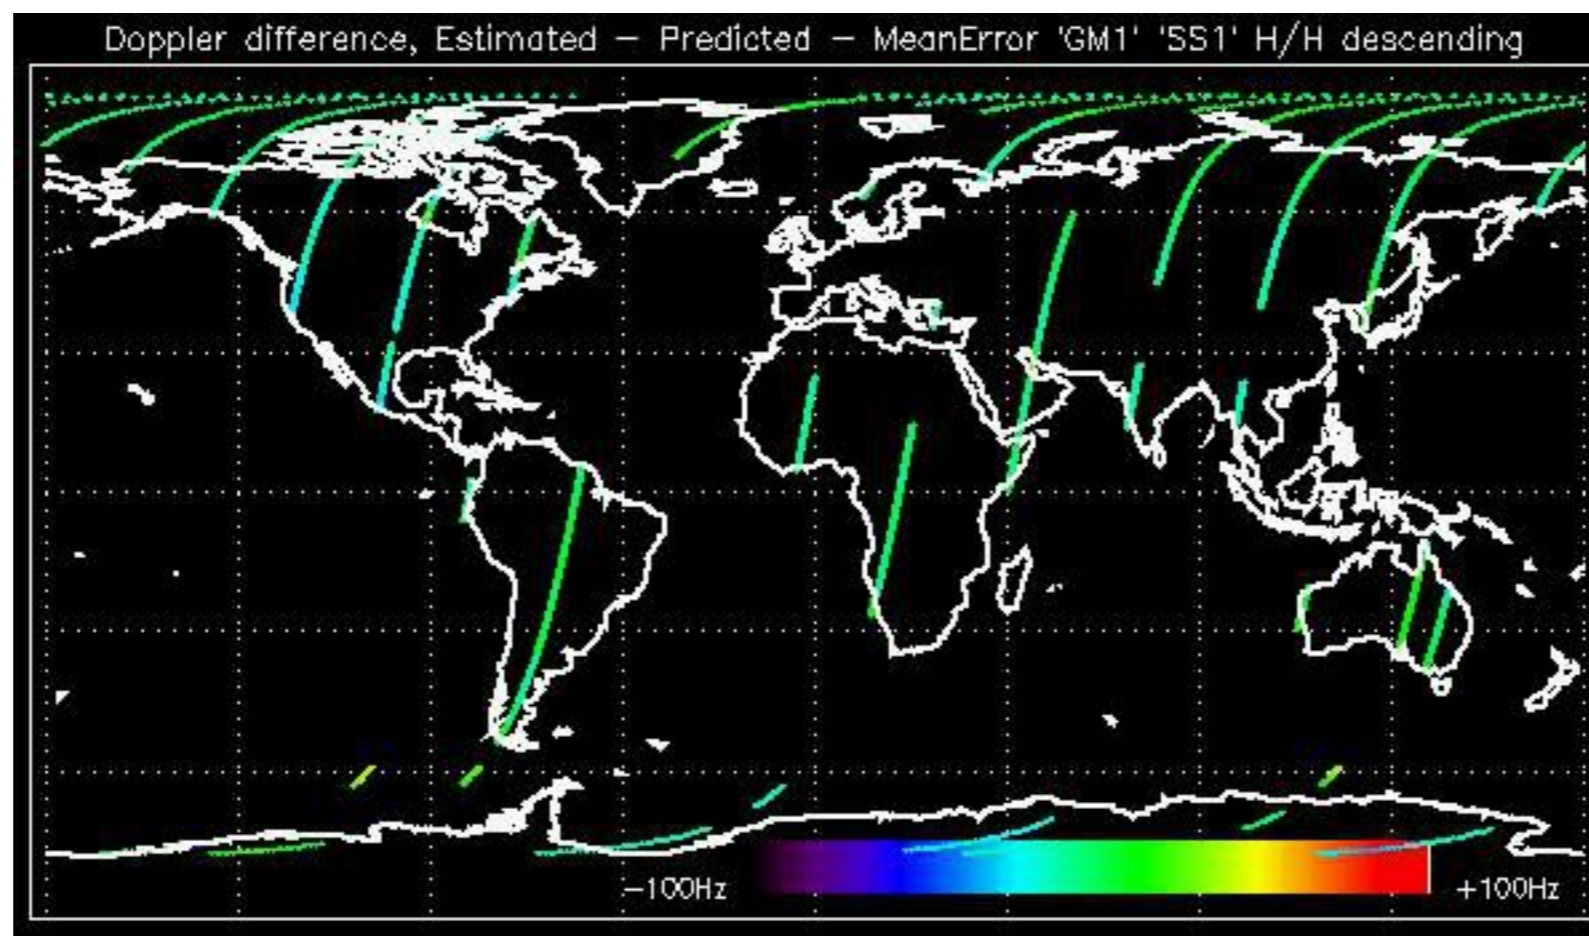


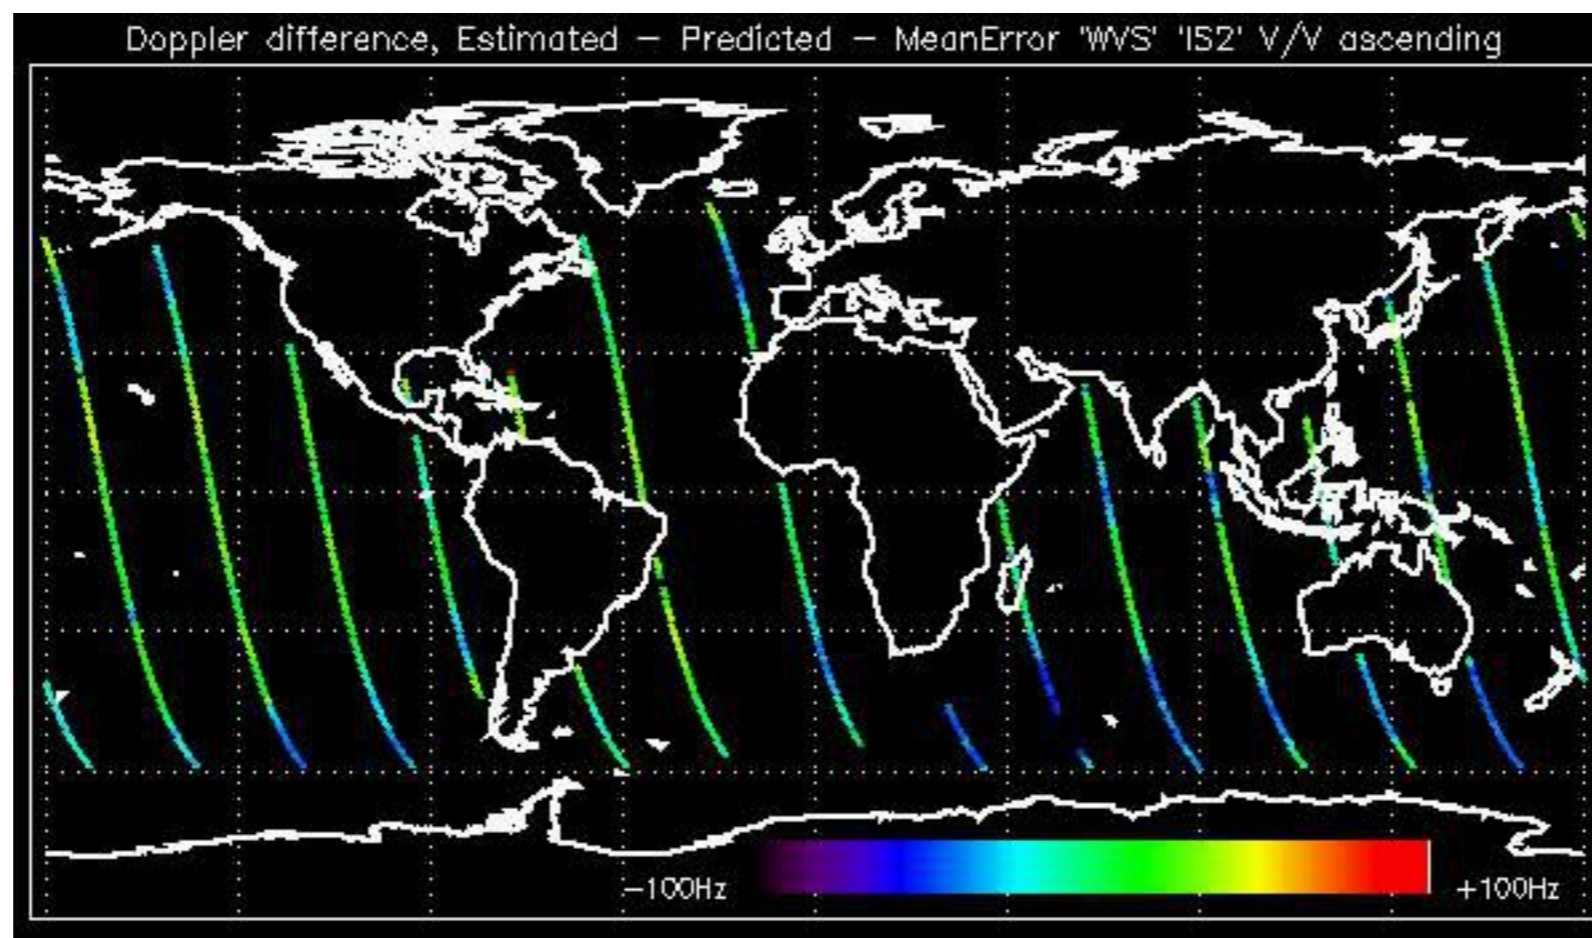

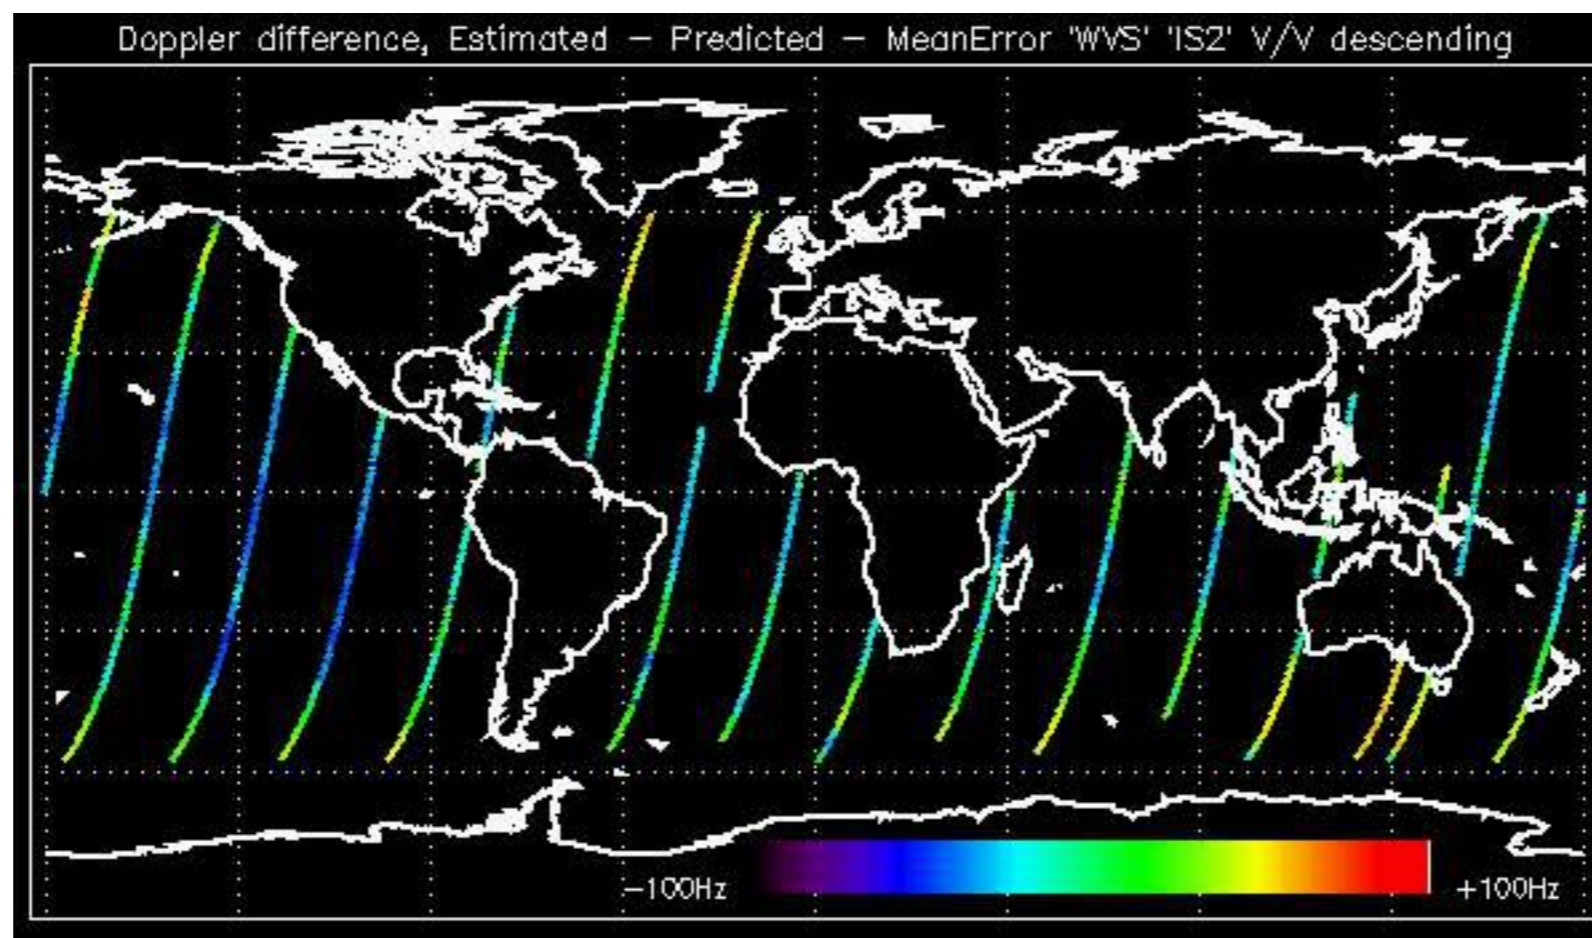




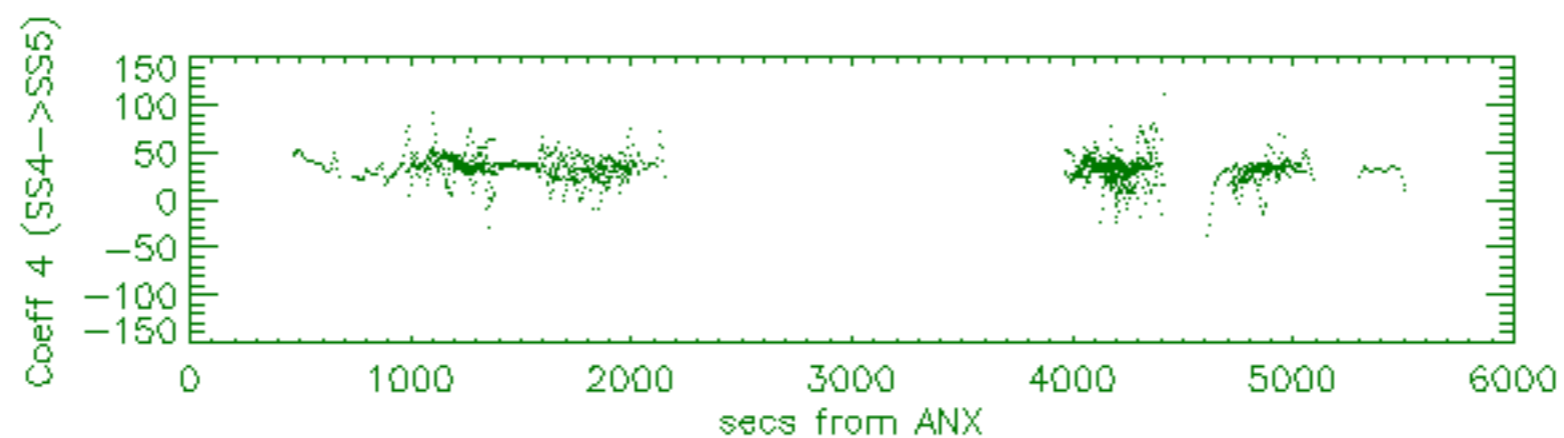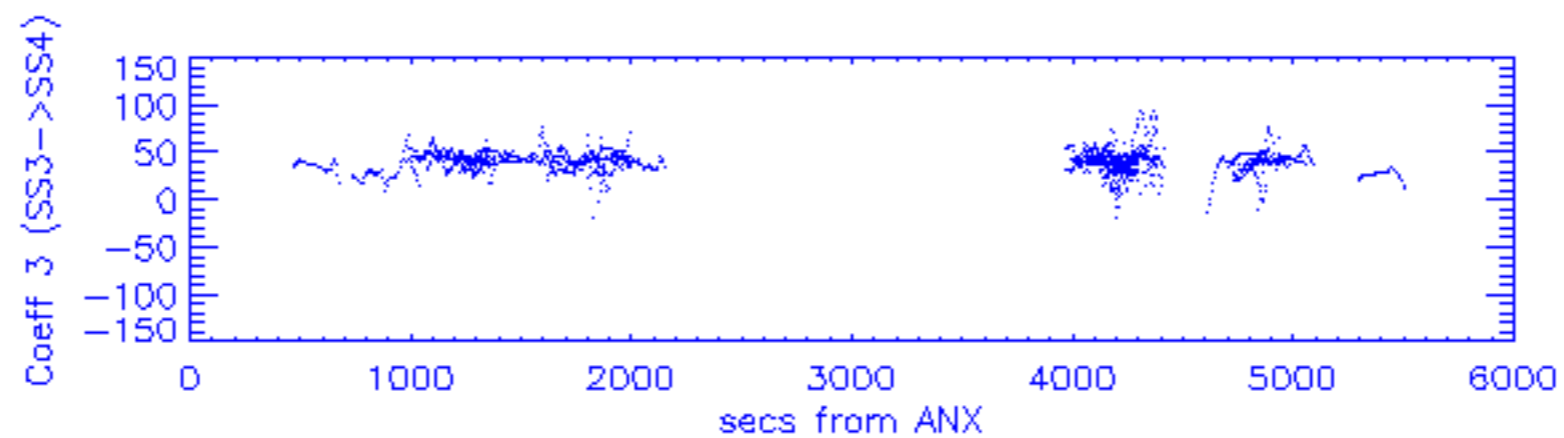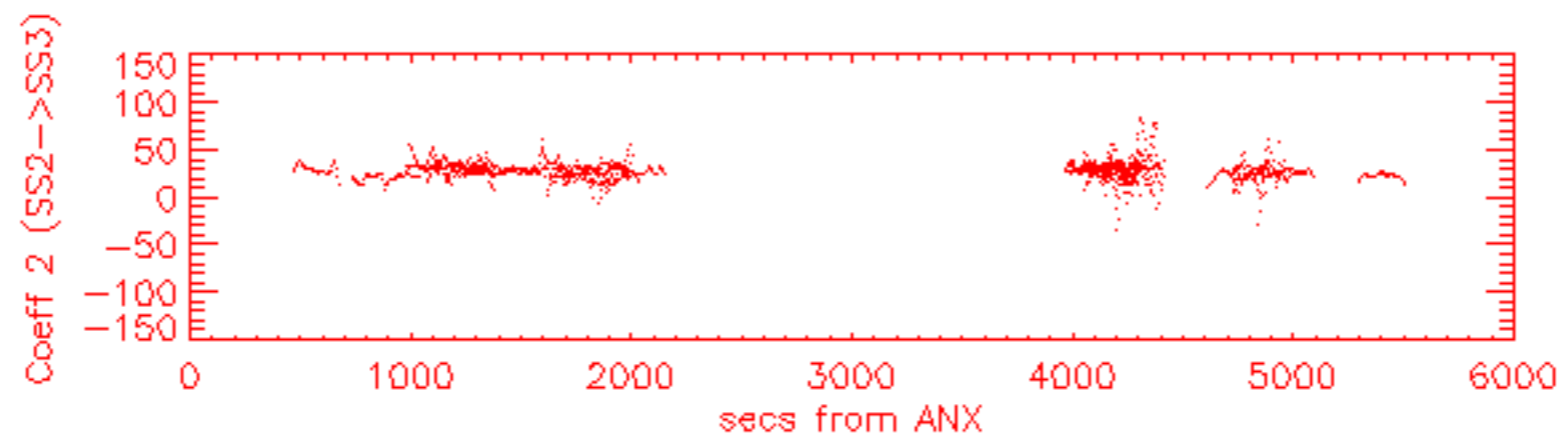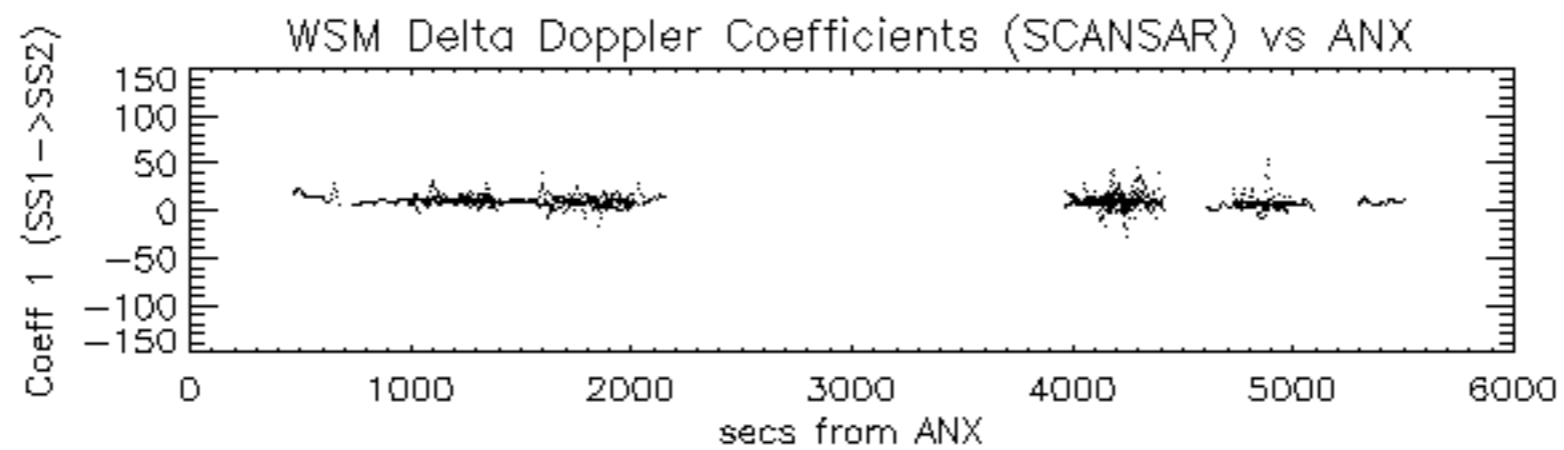

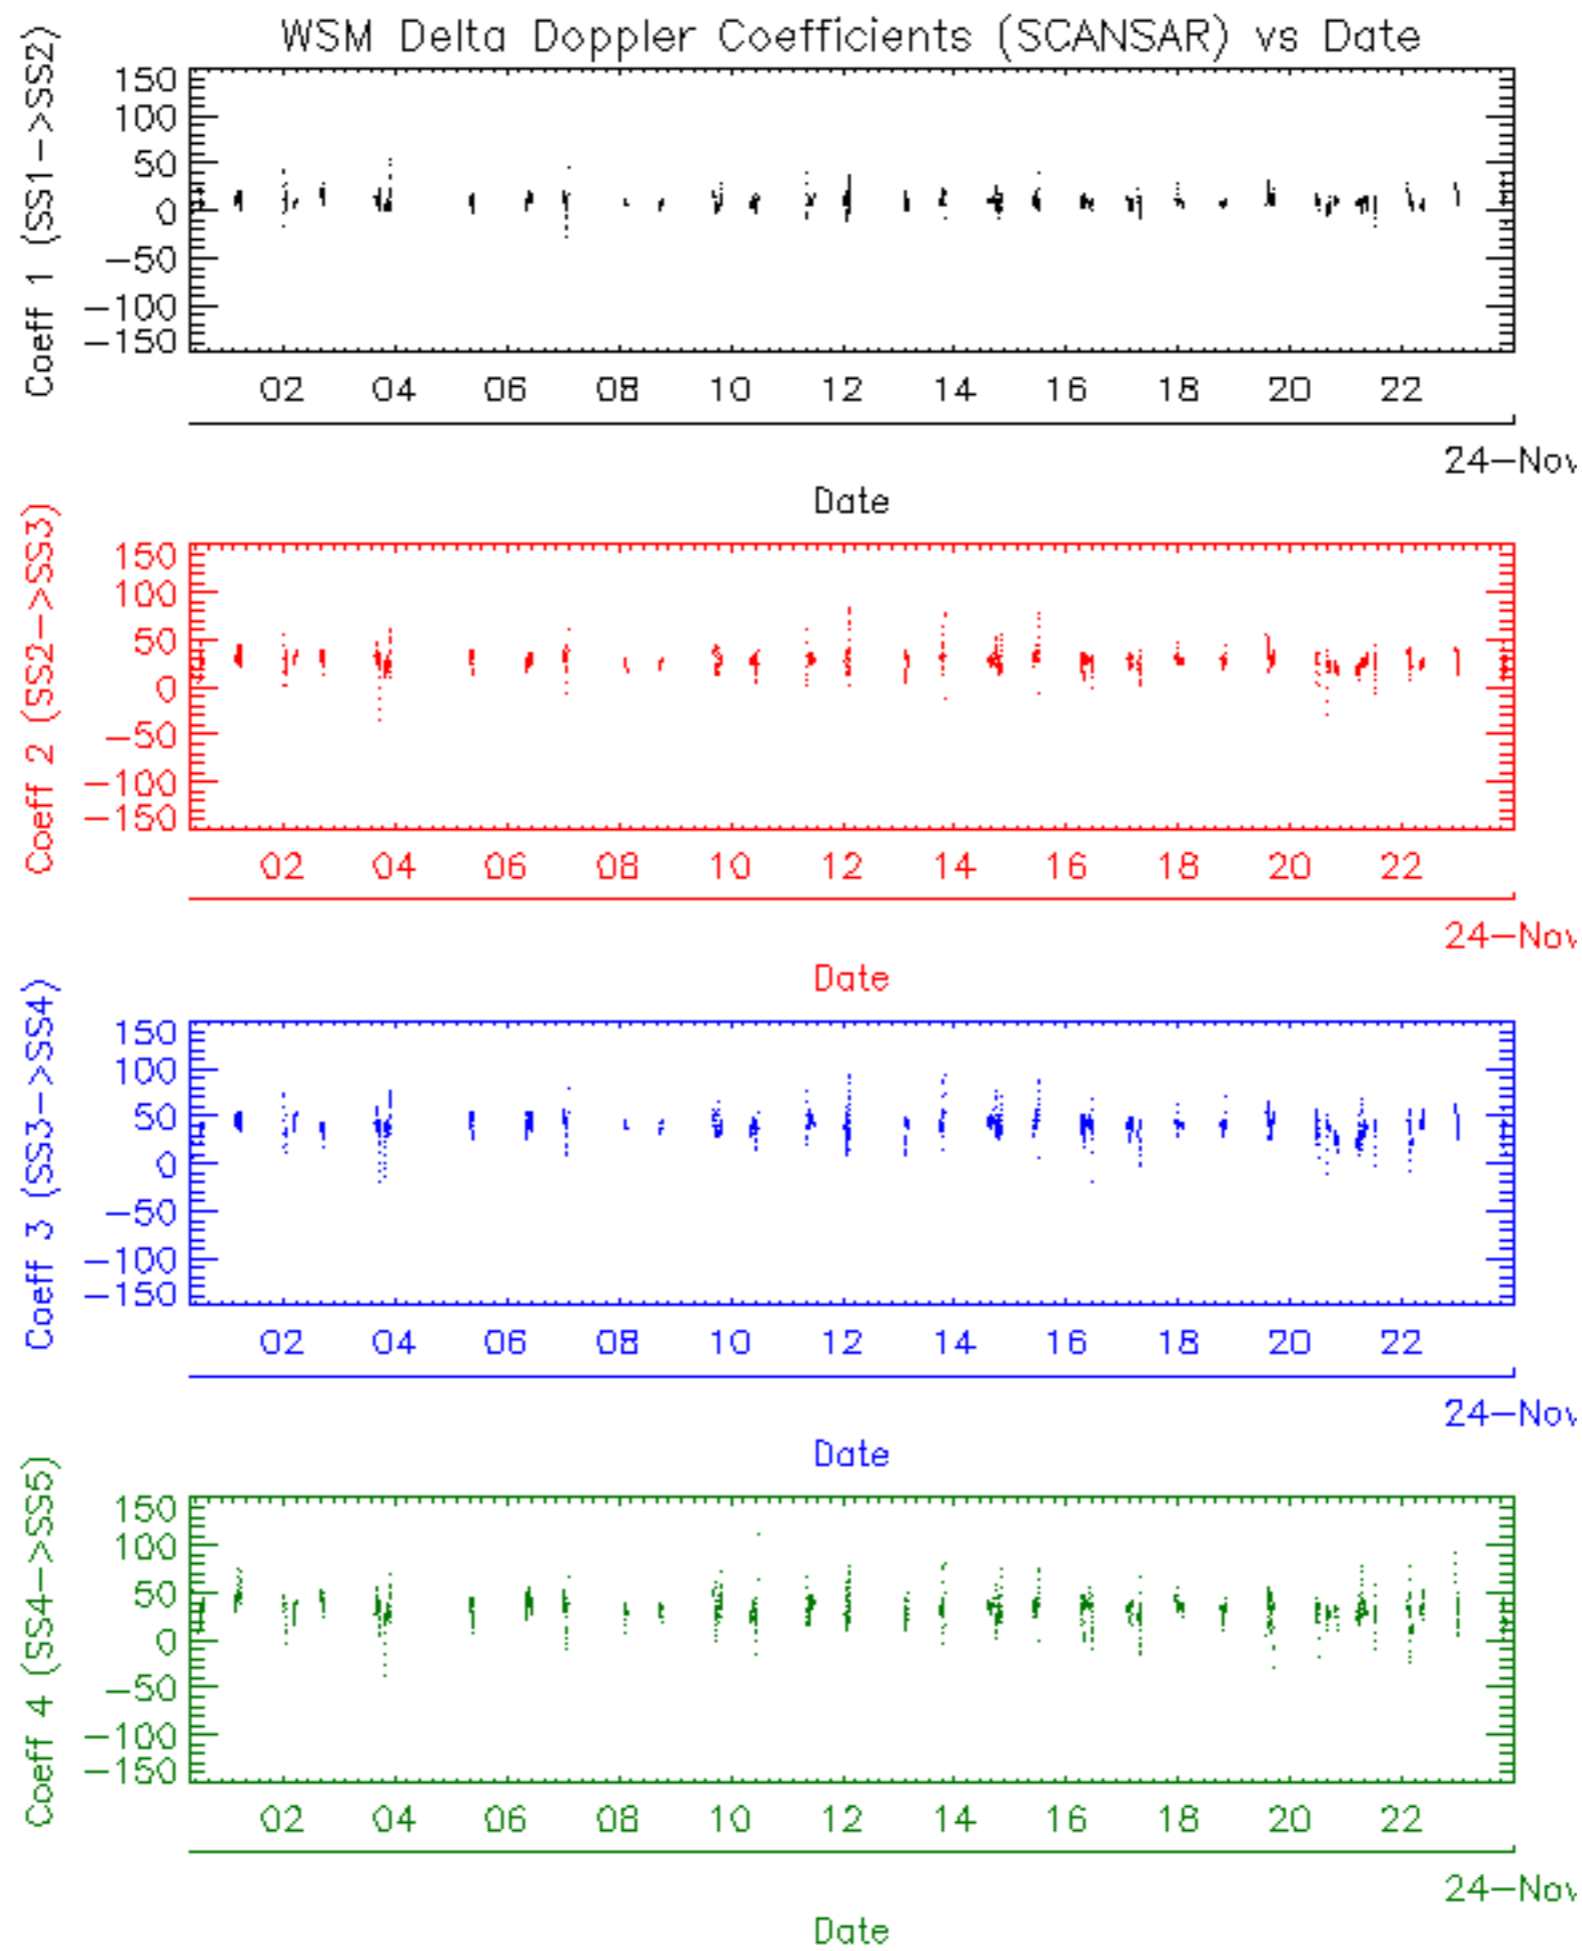





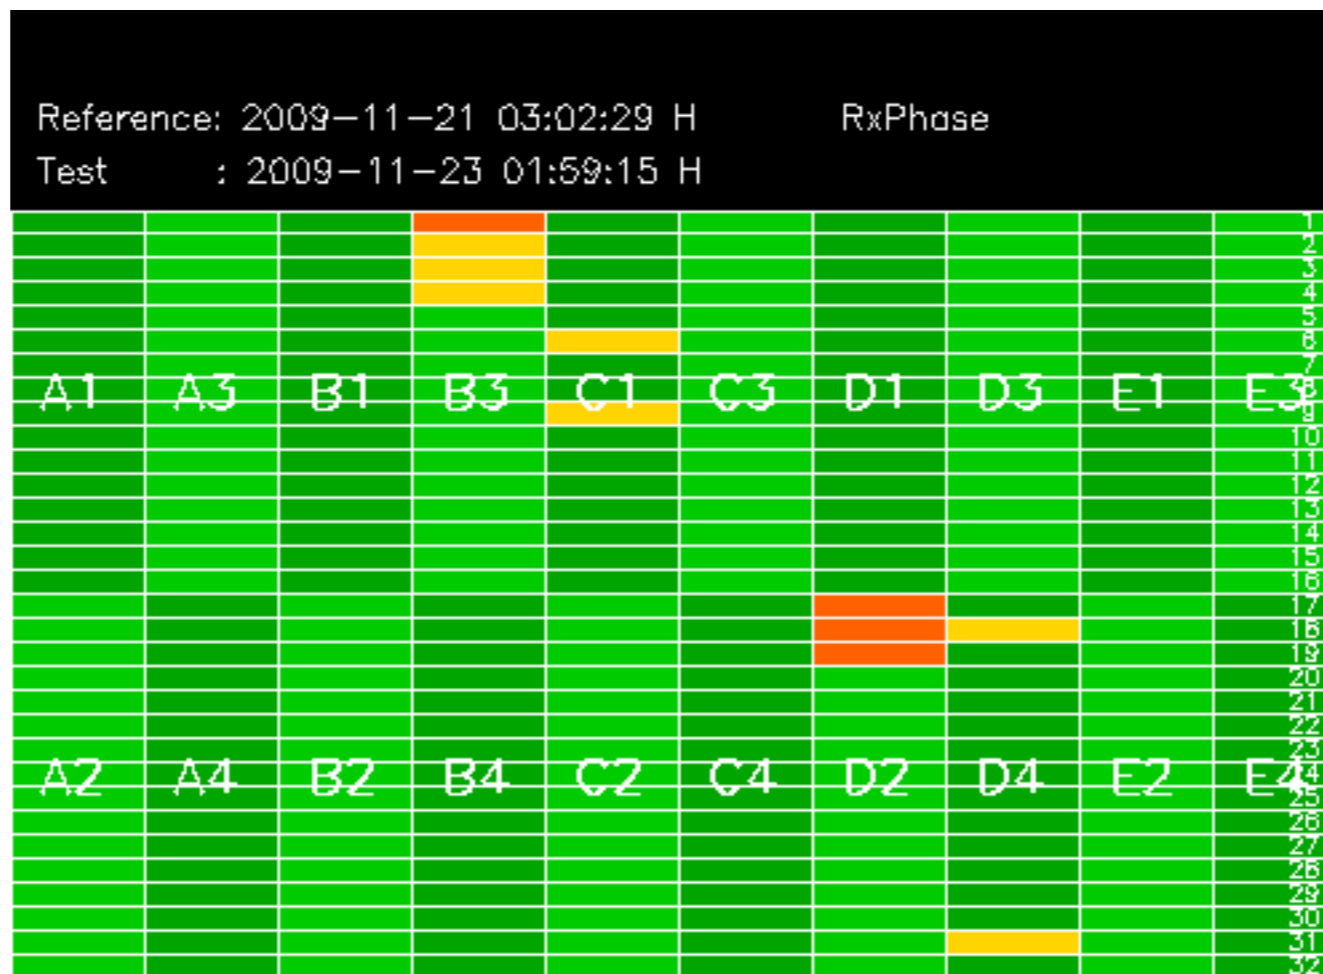
















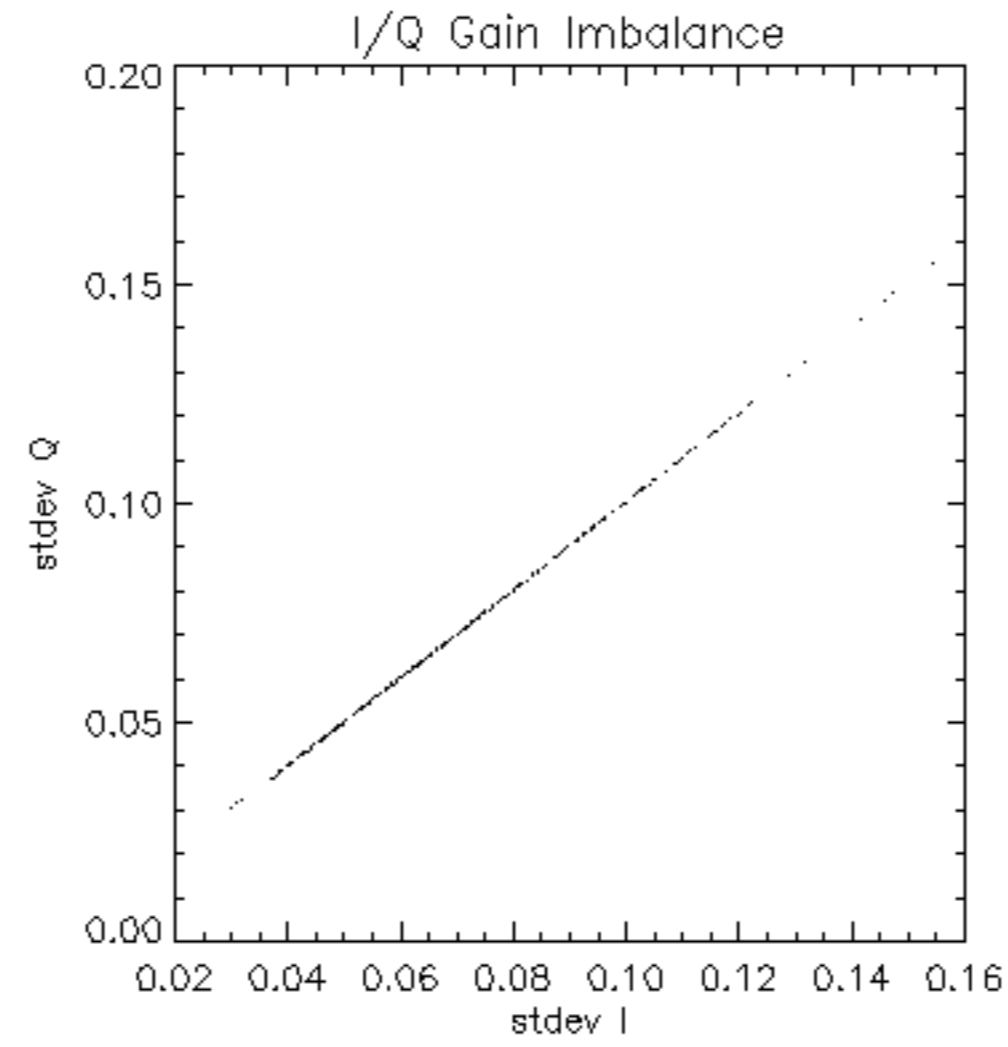


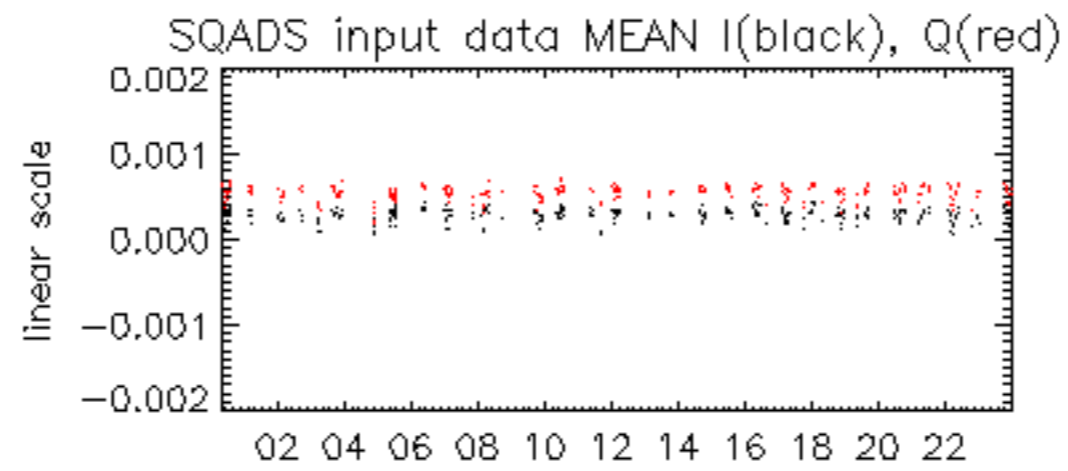


23-Nov

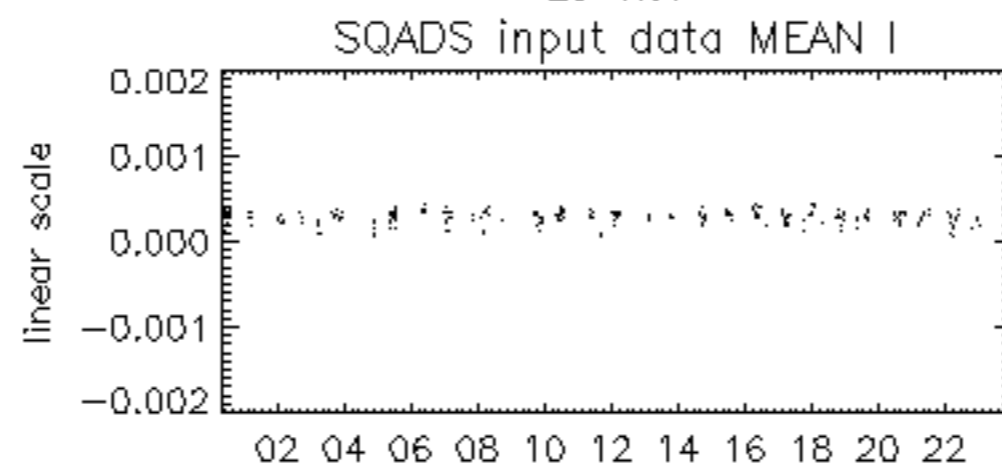


23-Nov

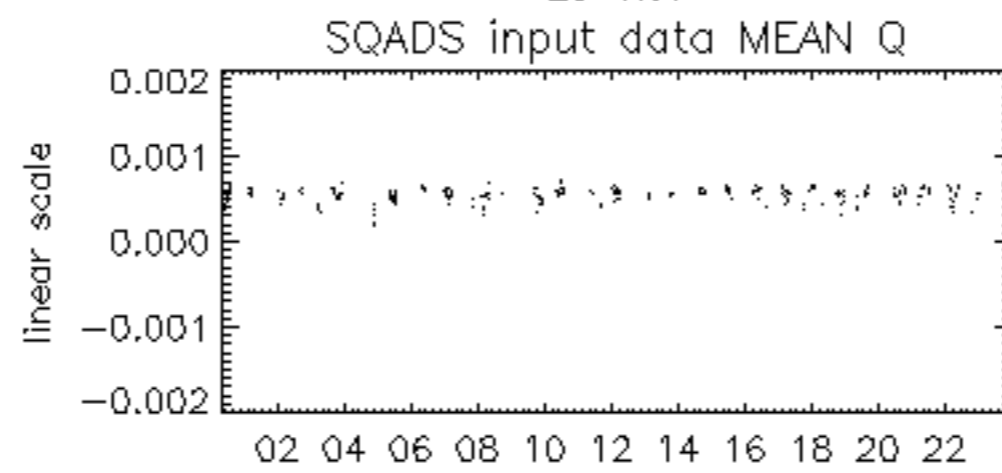


23-Nov

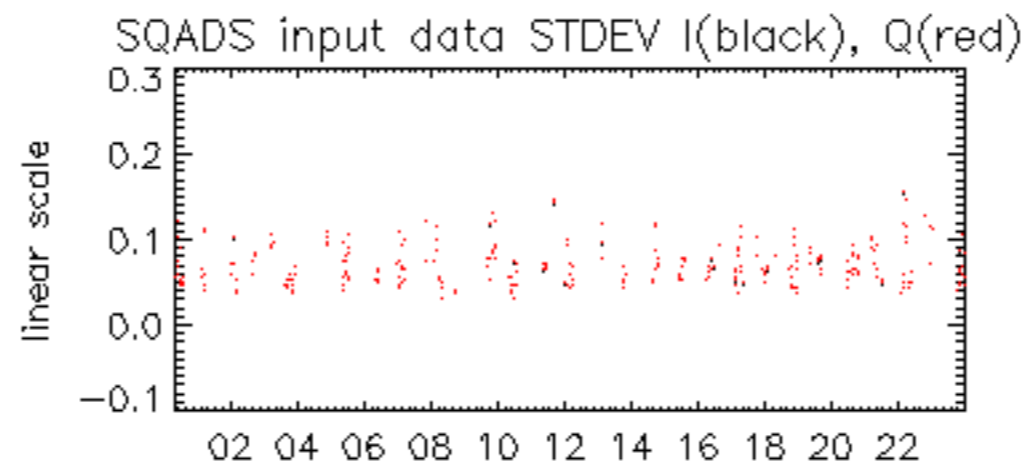


23-Nov

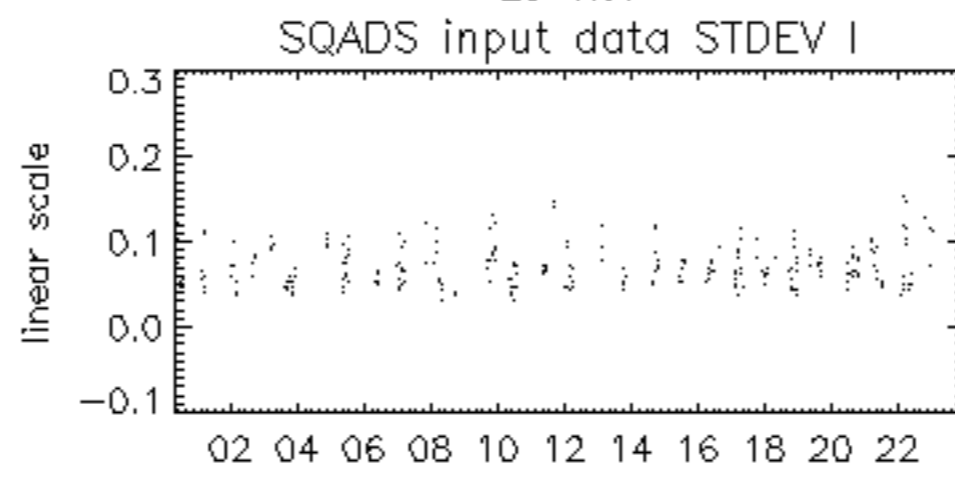


23-Nov

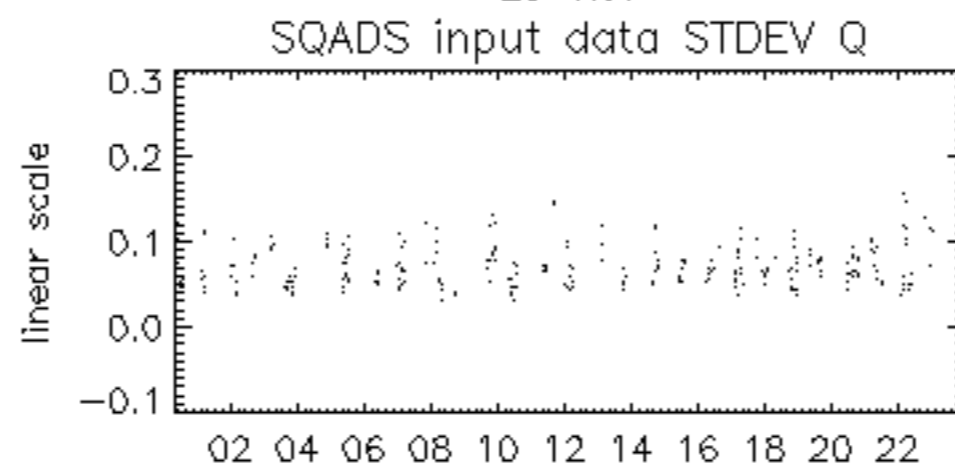


23-Nov

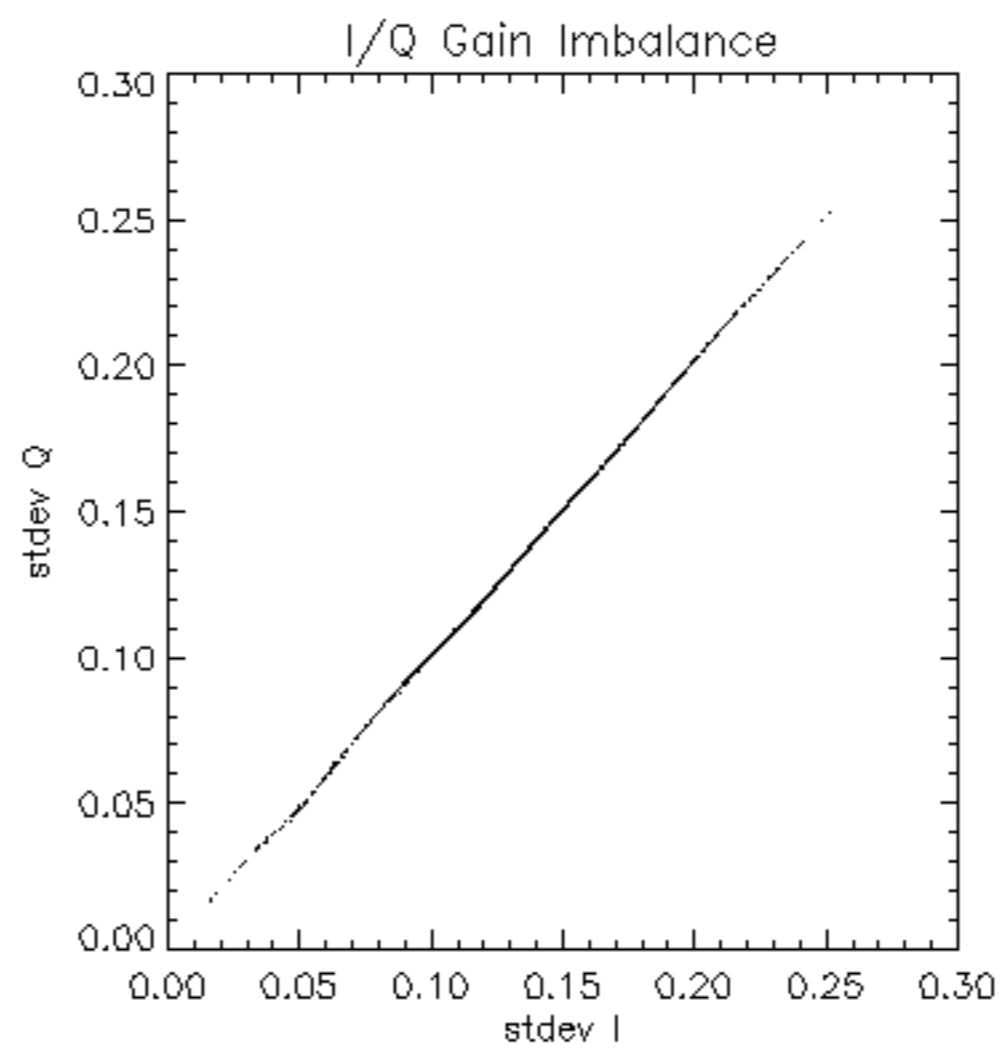


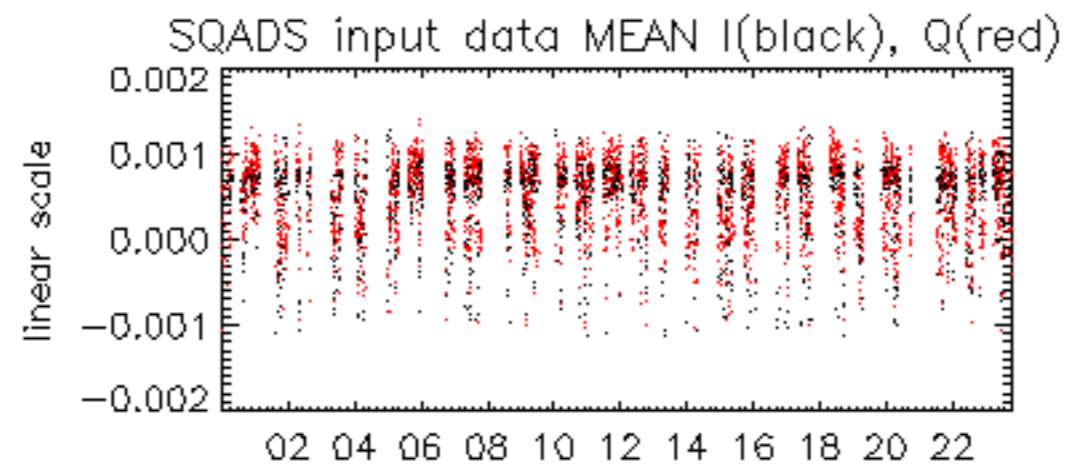


23-Nov

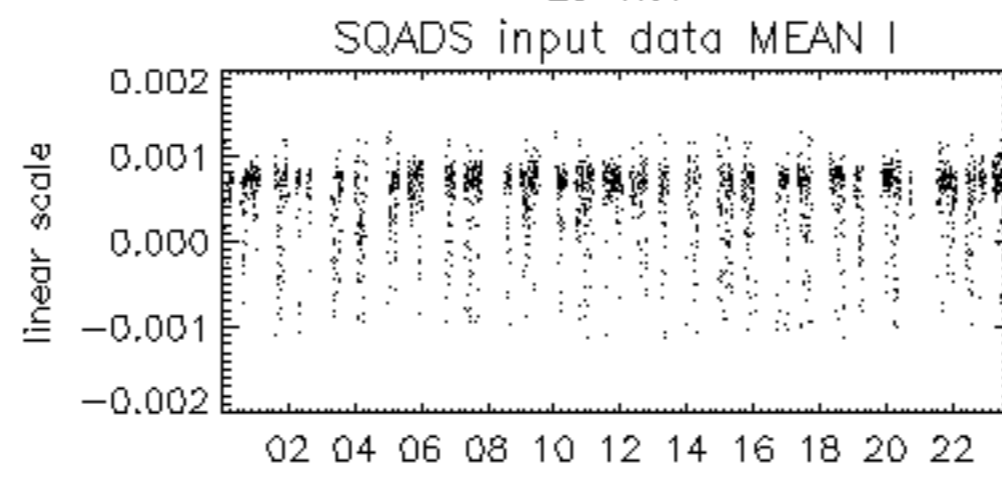


23-Nov

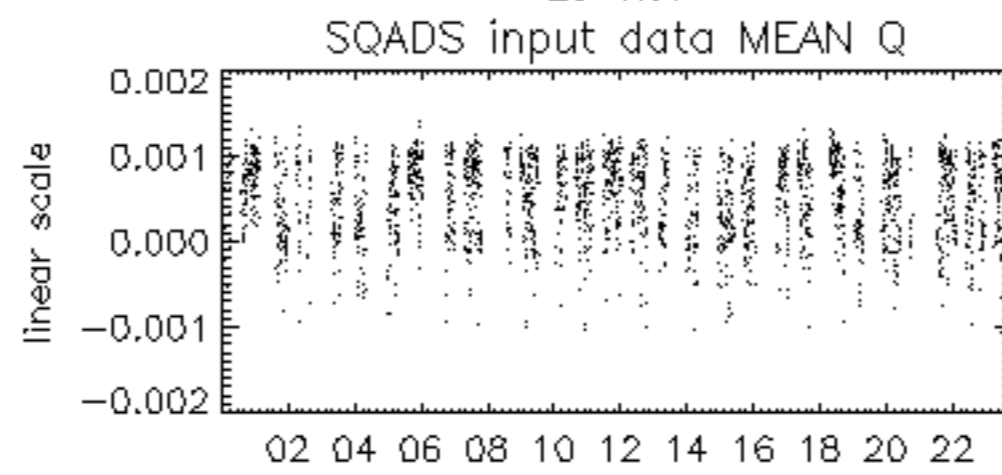


23-Nov

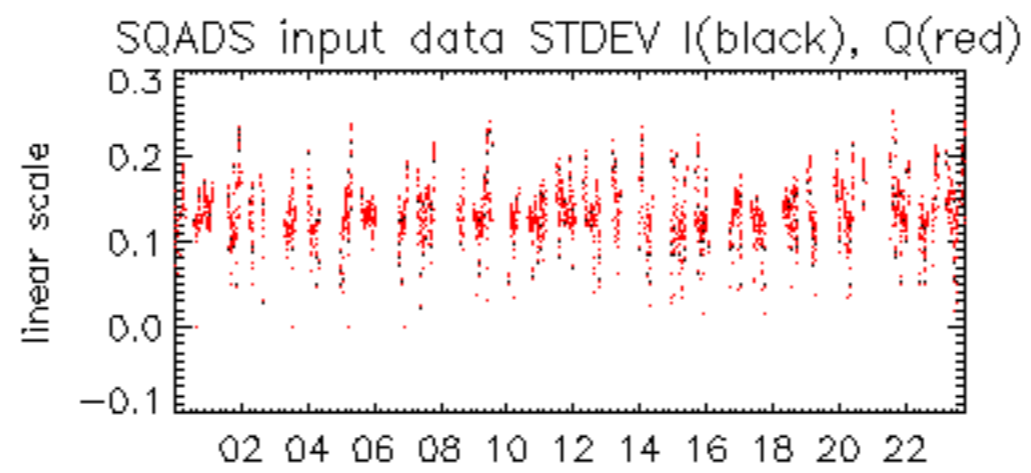

23-Nov

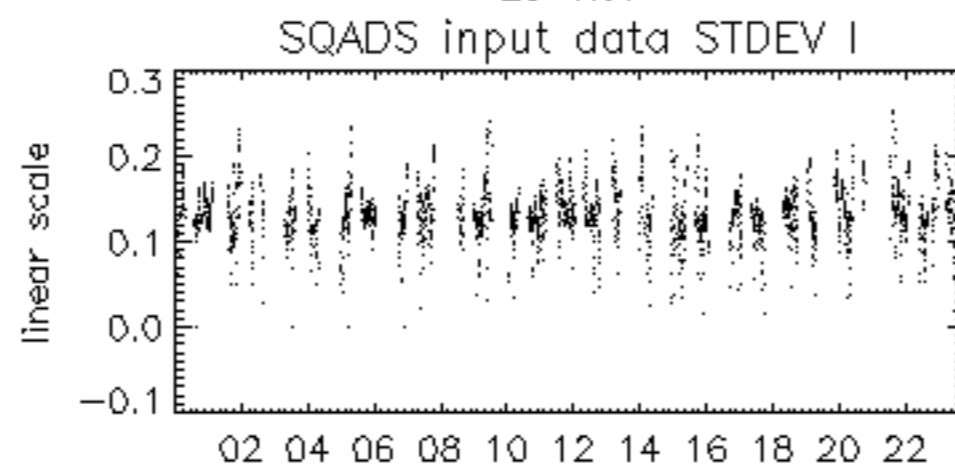

23-Nov

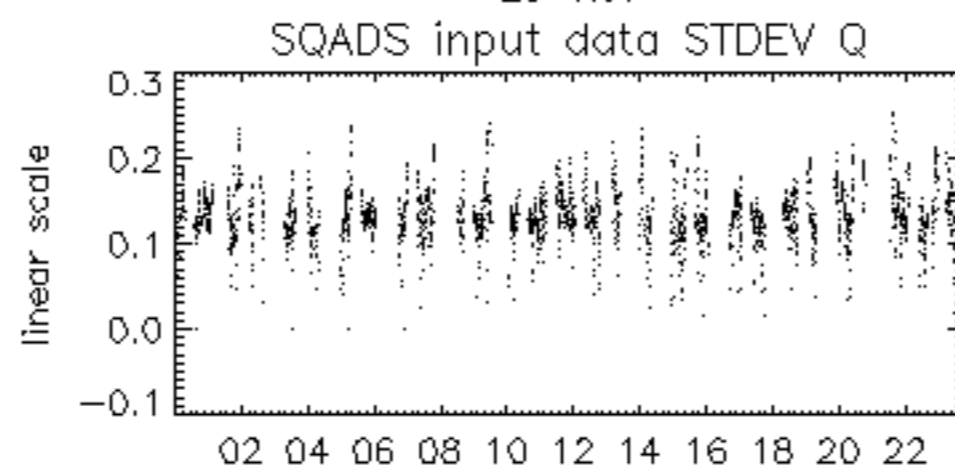

23-Nov





