



Analysis from 07-JAN-2011 00:00:00 to 07-JAN-2011 23:59:59. Page generated on 08-JAN-2011 07:32:20.
View log file: ASAR_Daily_Report_20110108_0731.log. For any anomalies please contact emma.griffiths@vega.co.uk, kajal.haria@vega.co.uk.

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

SUMMARY

1. DATA SUMMARY
 - 1.1 Summary tables
 - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
 - 2.1 IECF operational ADFs list
 - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
 - 3.1 V/V polarisation
 - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
 - 4.1 Analysis for WVS IS2 V/V
 - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
 - 4.1.2 All Rows Analysis for WVS IS2 V/V
 - 4.2 Analysis for GM1 SS3 H/H
 - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
 - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
 - 5.1 Analysis for WVS IS2 V/V
 - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
 - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
 - 5.2 Analysis for GM1 SS1 H/H
 - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
 - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
 - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
 - 6.1 Analysis for WSM SS1 H/H
 - 6.1.1 ScaleFactor
 - 6.2 Analysis for WSM SS1 V/V
 - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
 - 7.1 Analysis for WVS
 - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
 - 8.1 Number of Missing Lines
 - 8.2 Number of Gaps

1 - DATA SUMMARY

1.1 - Summary tables

[[BACK TO MENU](#)]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	5	PDE	WS	H/H	36	PDE	IS1	H/H	1	PDE	IS6	H/H	2	PDE	WS	H/H	29	PDK	2011-01-07 15:45:40	H	320
PDE	IS2	V/V	28	PDK	WS	H/H	36	PDE	IS4	V/H	1	PDE	IS7	V/V	1	PDE	WS	V/V	10	PDK	2011-01-07 17:25:54	V	320
PDK	IS2	V/V	23					PDE	IS4	V/V	1	PDK	IS6	H/H	3	PDK	WS	H/H	9				
								PDK	IS4	V/V	1					PDK	WS	V/V	4				

1.2 - Lists of products used

[[BACK TO MENU](#)]

[TXT] [XLS] [List_WVS_products_used](#)
 [TXT] [XLS] [List_GM1_products_used](#)
 [TXT] [XLS] [List_APM_products_used](#)
 [TXT] [XLS] [List_IMM_products_used](#)
 [TXT] [XLS] [List_WSM_products_used](#)
 [TXT] [XLS] [List_MS_products_used](#)

2 - AUXILIARY FILES ANALYSIS

2.1 - IECF operational ADFs list

[[BACK TO MENU](#)]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20101222_141422_20100317_120410_20141231_000000
ASA_INS_AXVIEC20101222_143805_20101022_000000_20141231_235959
ASA_XCH_AXVIEC20101222_143057_20020301_000000_20141231_000000
ASA_XCA_AXVIEC20101111_113830_20100601_000000_20141231_000000

2.2 - Products with wrong ADFs

[[BACK TO MENU](#)]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0

[TXT] [XLS] [Check_ADFs_WVS](#)
 [TXT] [XLS] [Check_ADFs_GM1](#)
 [TXT] [XLS] [Check_ADFs_APM](#)
 [TXT] [XLS] [Check_ADFs_IMM](#)
 [TXT] [XLS] [Check_ADFs_WSM](#)

3 - MODULE STEPPING PRODUCTS ANALYSIS



SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
------------------------	----------------------------

Pre-launch reference (2001-02-09)

Previous product in the same polarisation


Reference: 2001-02-09 14:08:23 V RxGain
 Test : 2011-01-07 17:25:54 V





Reference: 2011-01-06 18:02:38 V RxGain
 Test : 2011-01-07 17:25:54 V

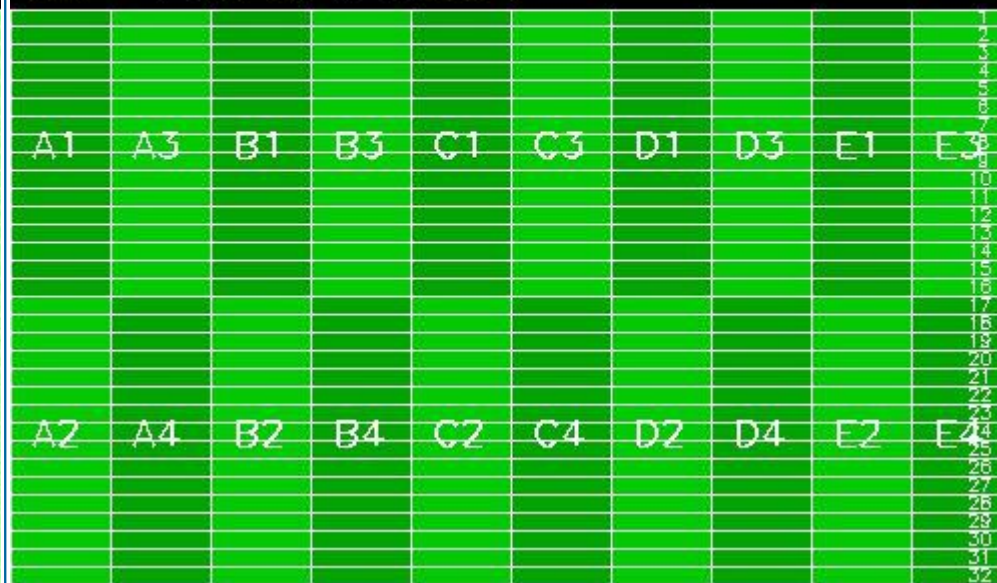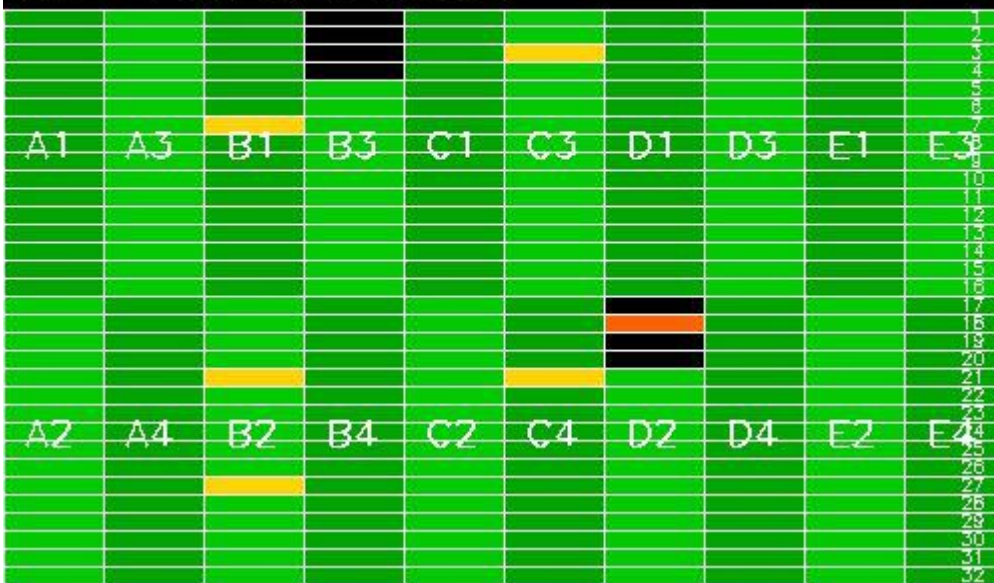

Reference: 2001-02-09 14:08:23 V RxPhase
 Test : 2011-01-07 17:25:54 V

Reference: 2011-01-06 18:02:38 V RxPhase
 Test : 2011-01-07 17:25:54 V




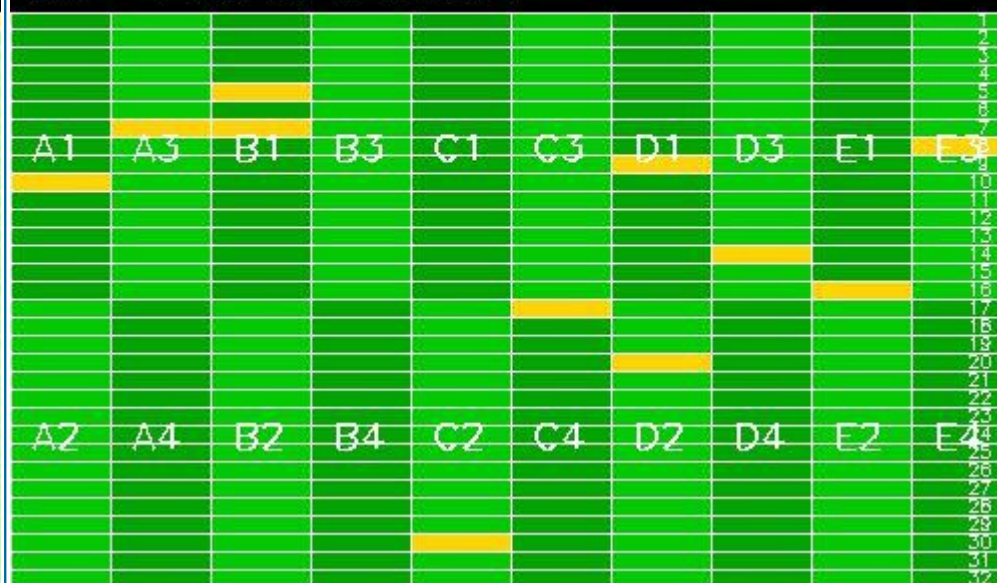


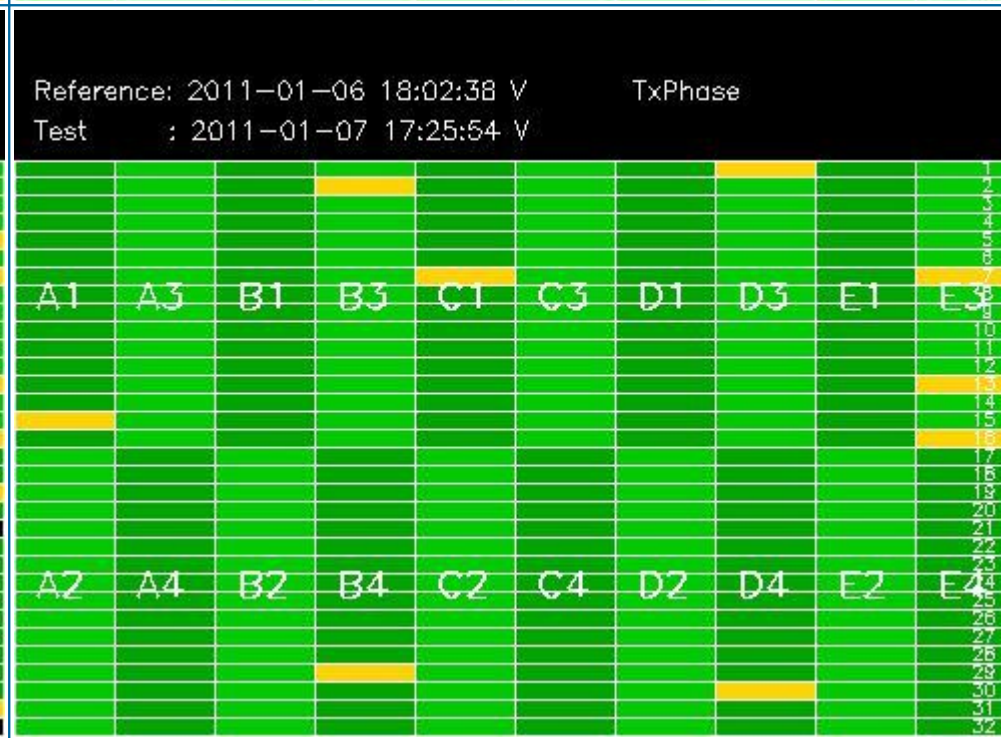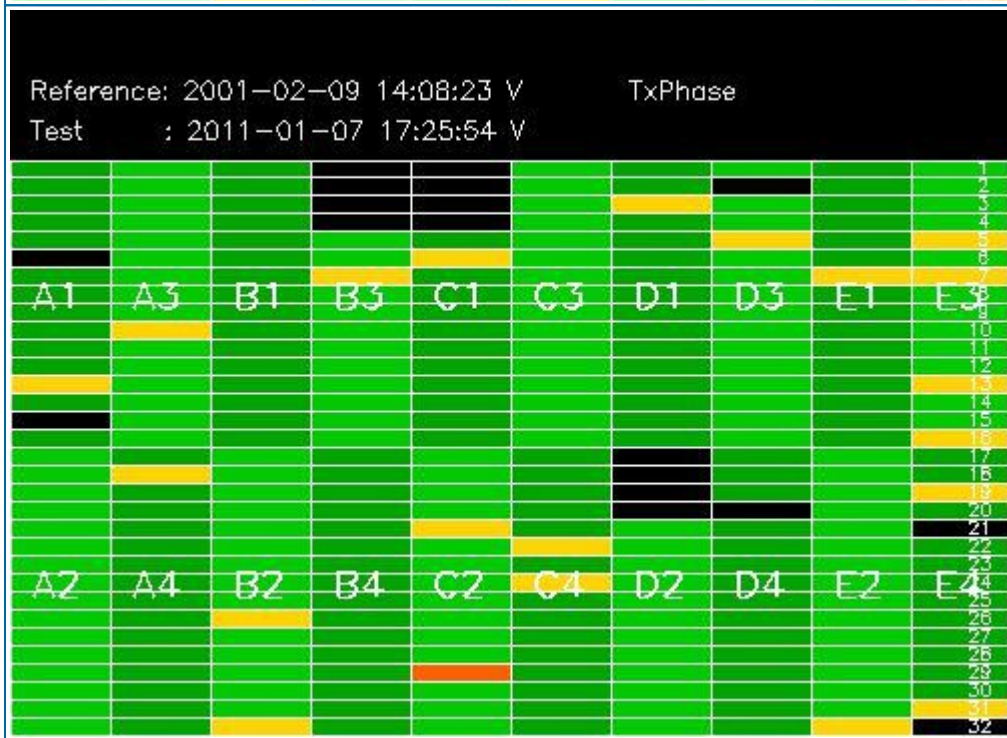
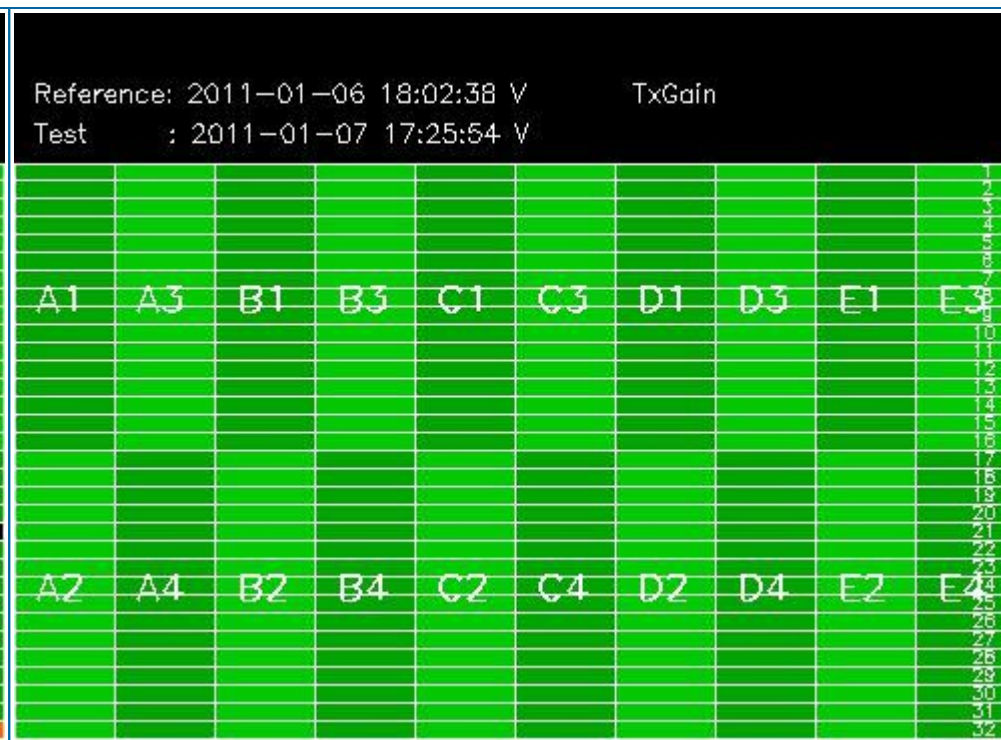
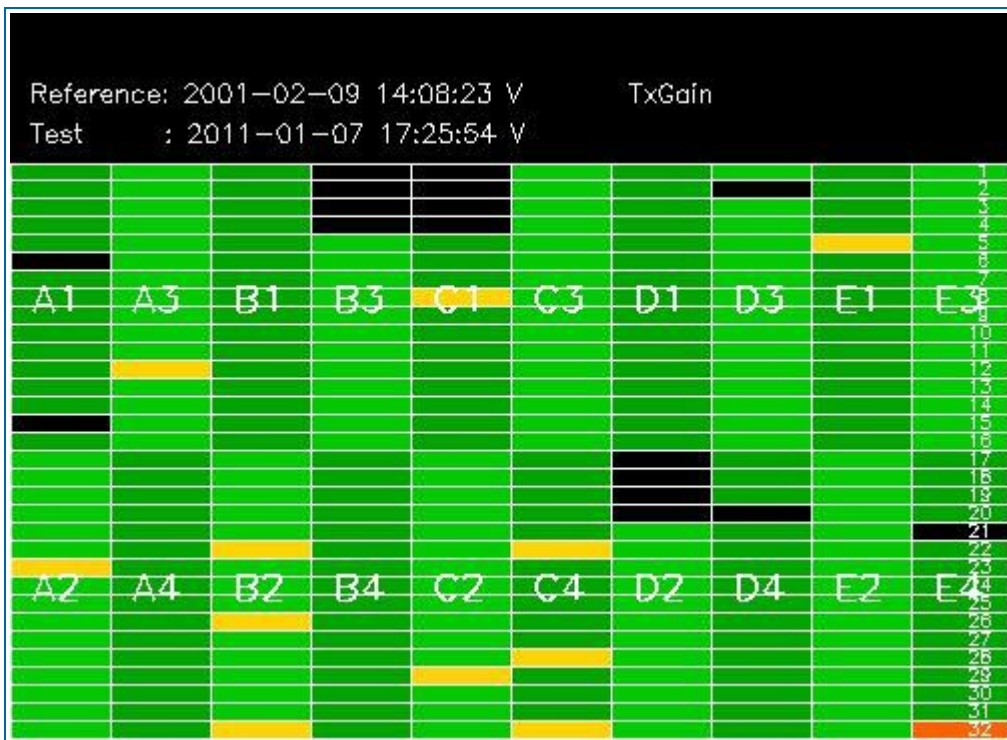


3.2 - H/H polarisation

[[BACK TO MENU](#)]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
Pre-launch reference (2001-02-09)	Previous product in the same polarisation

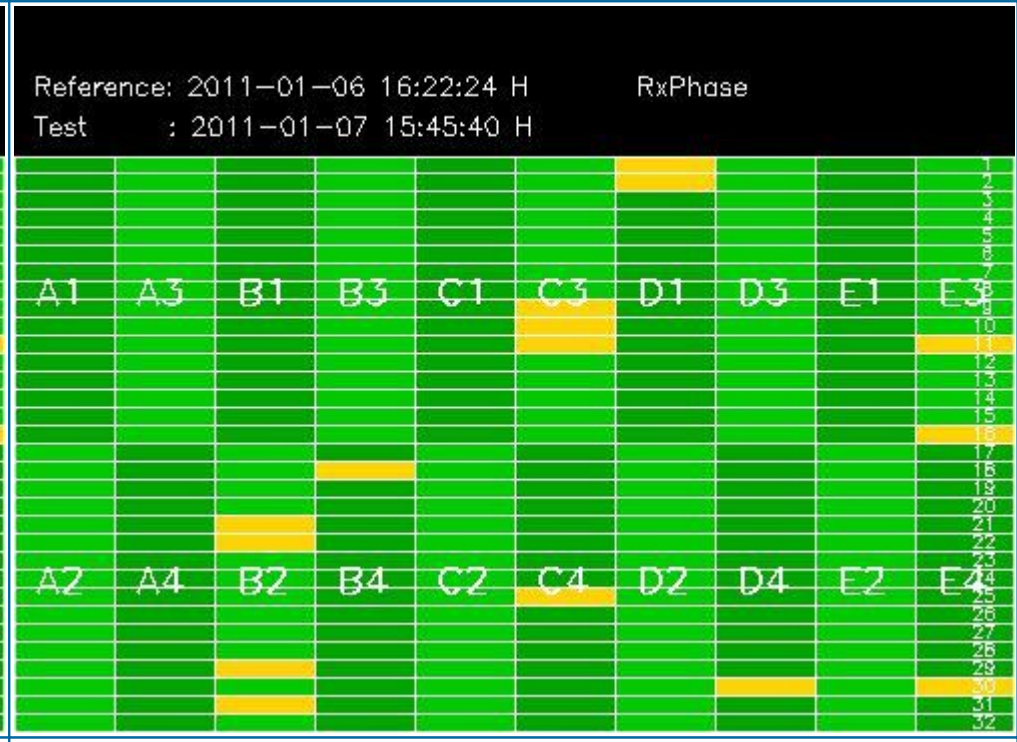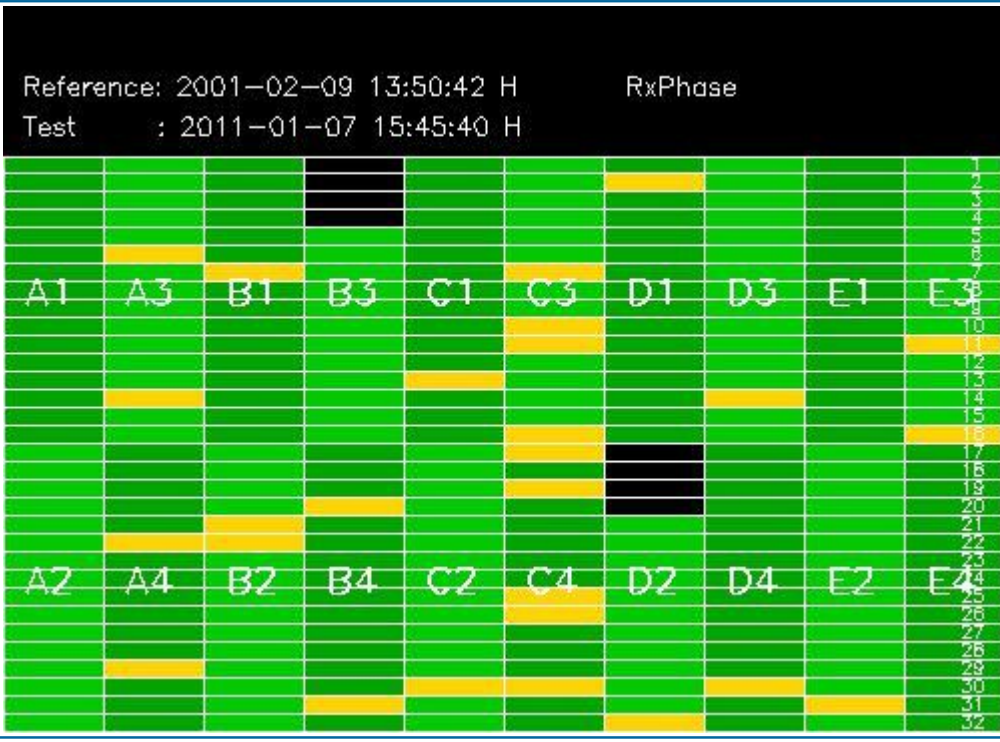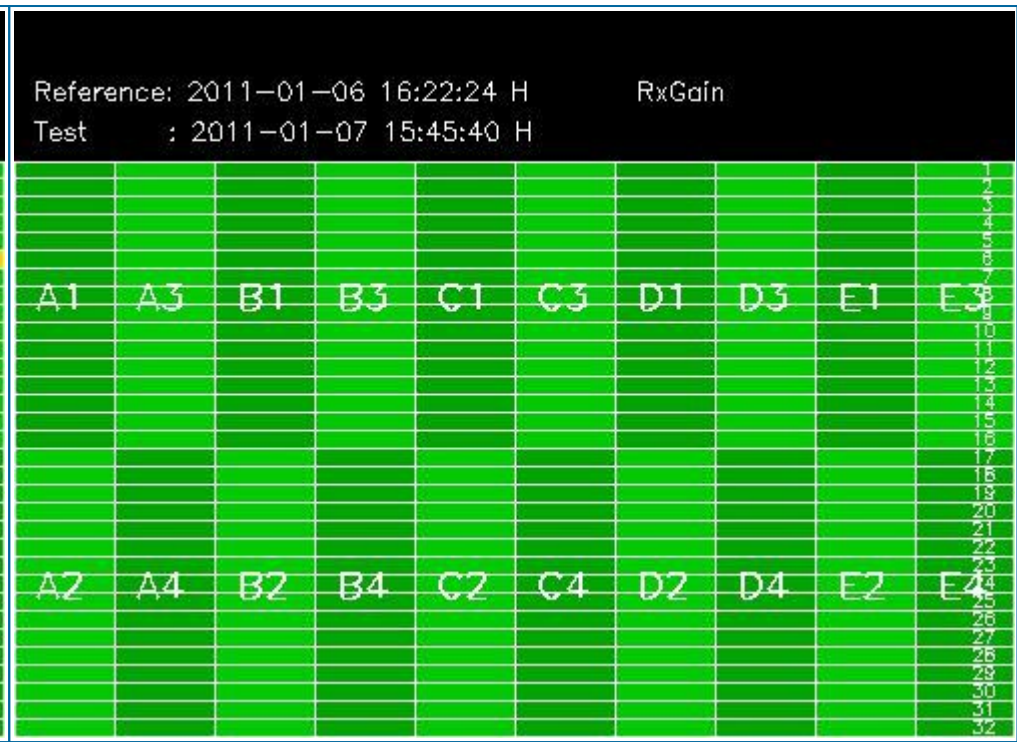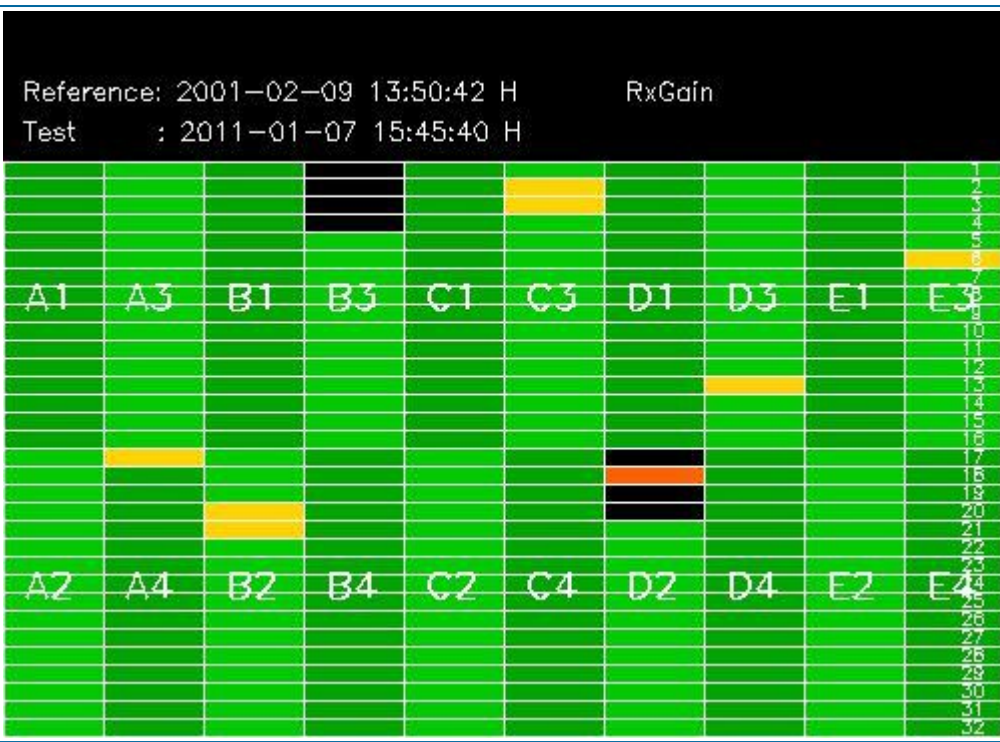

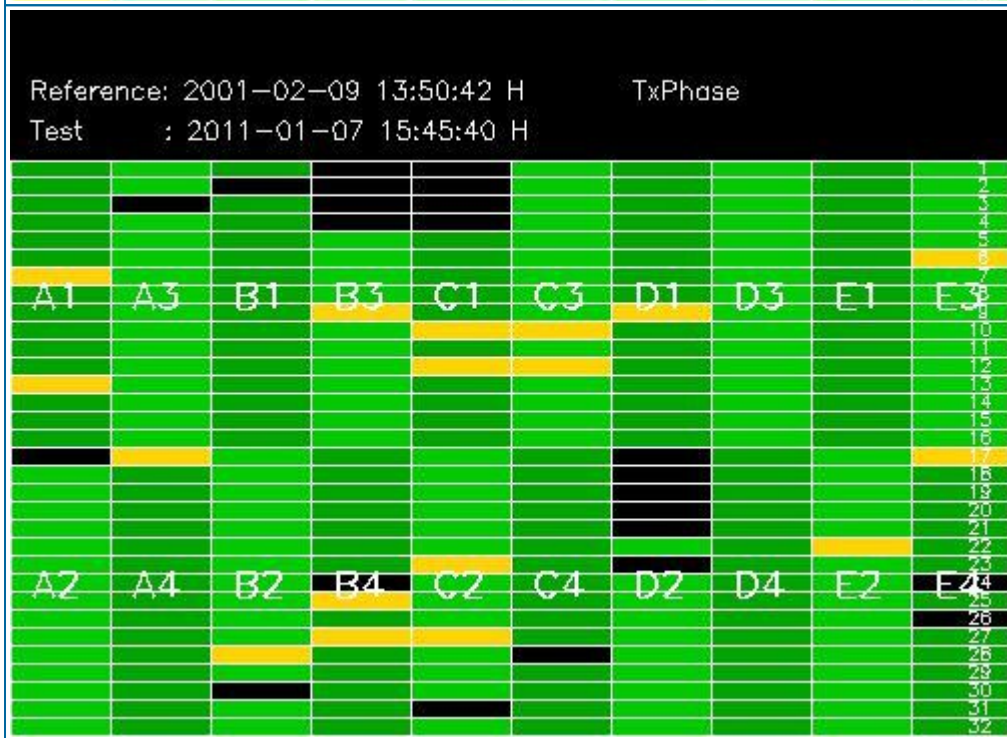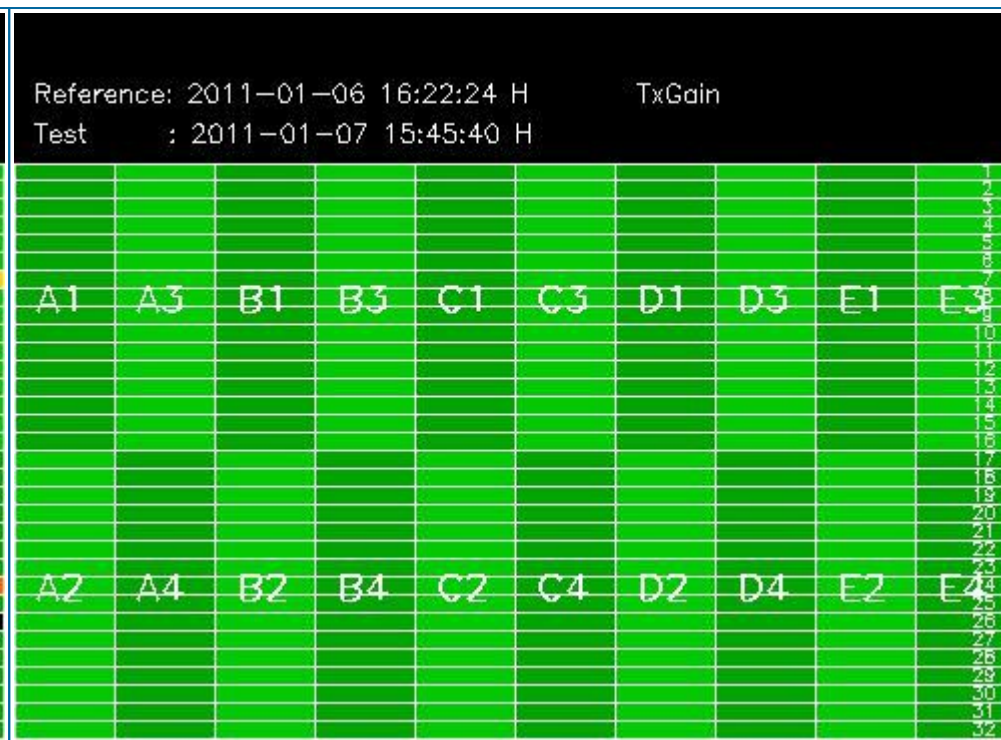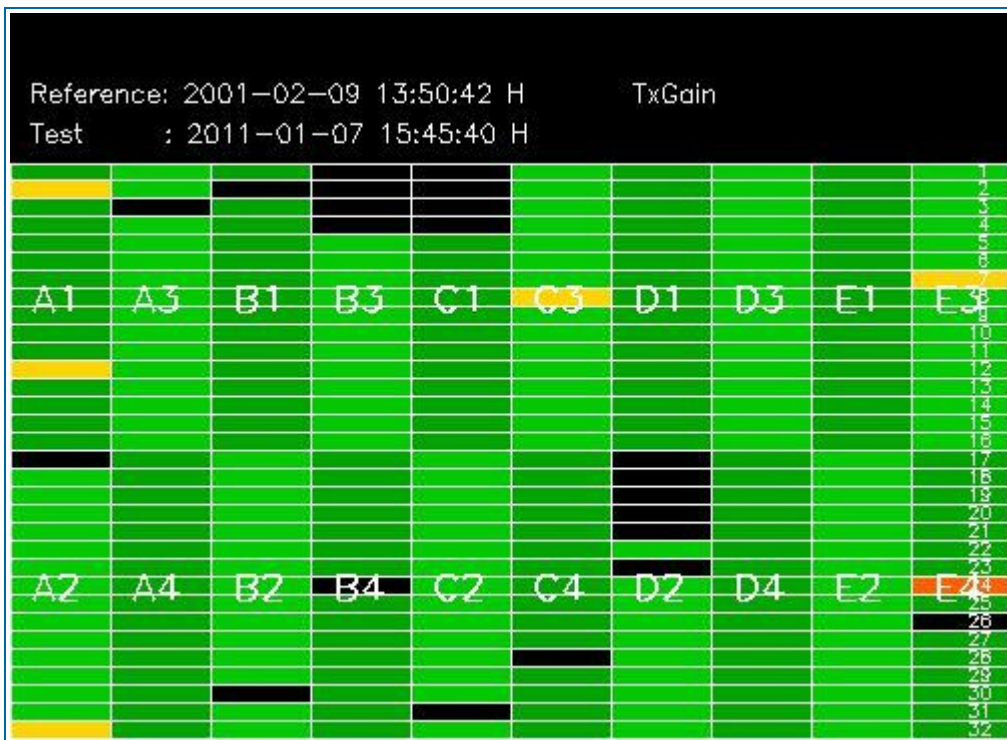

4 - CALIBRATION PULSES ANALYSIS

4.1 - Analysis for WVS IS2 V/V


4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for WVS IS2 V/V

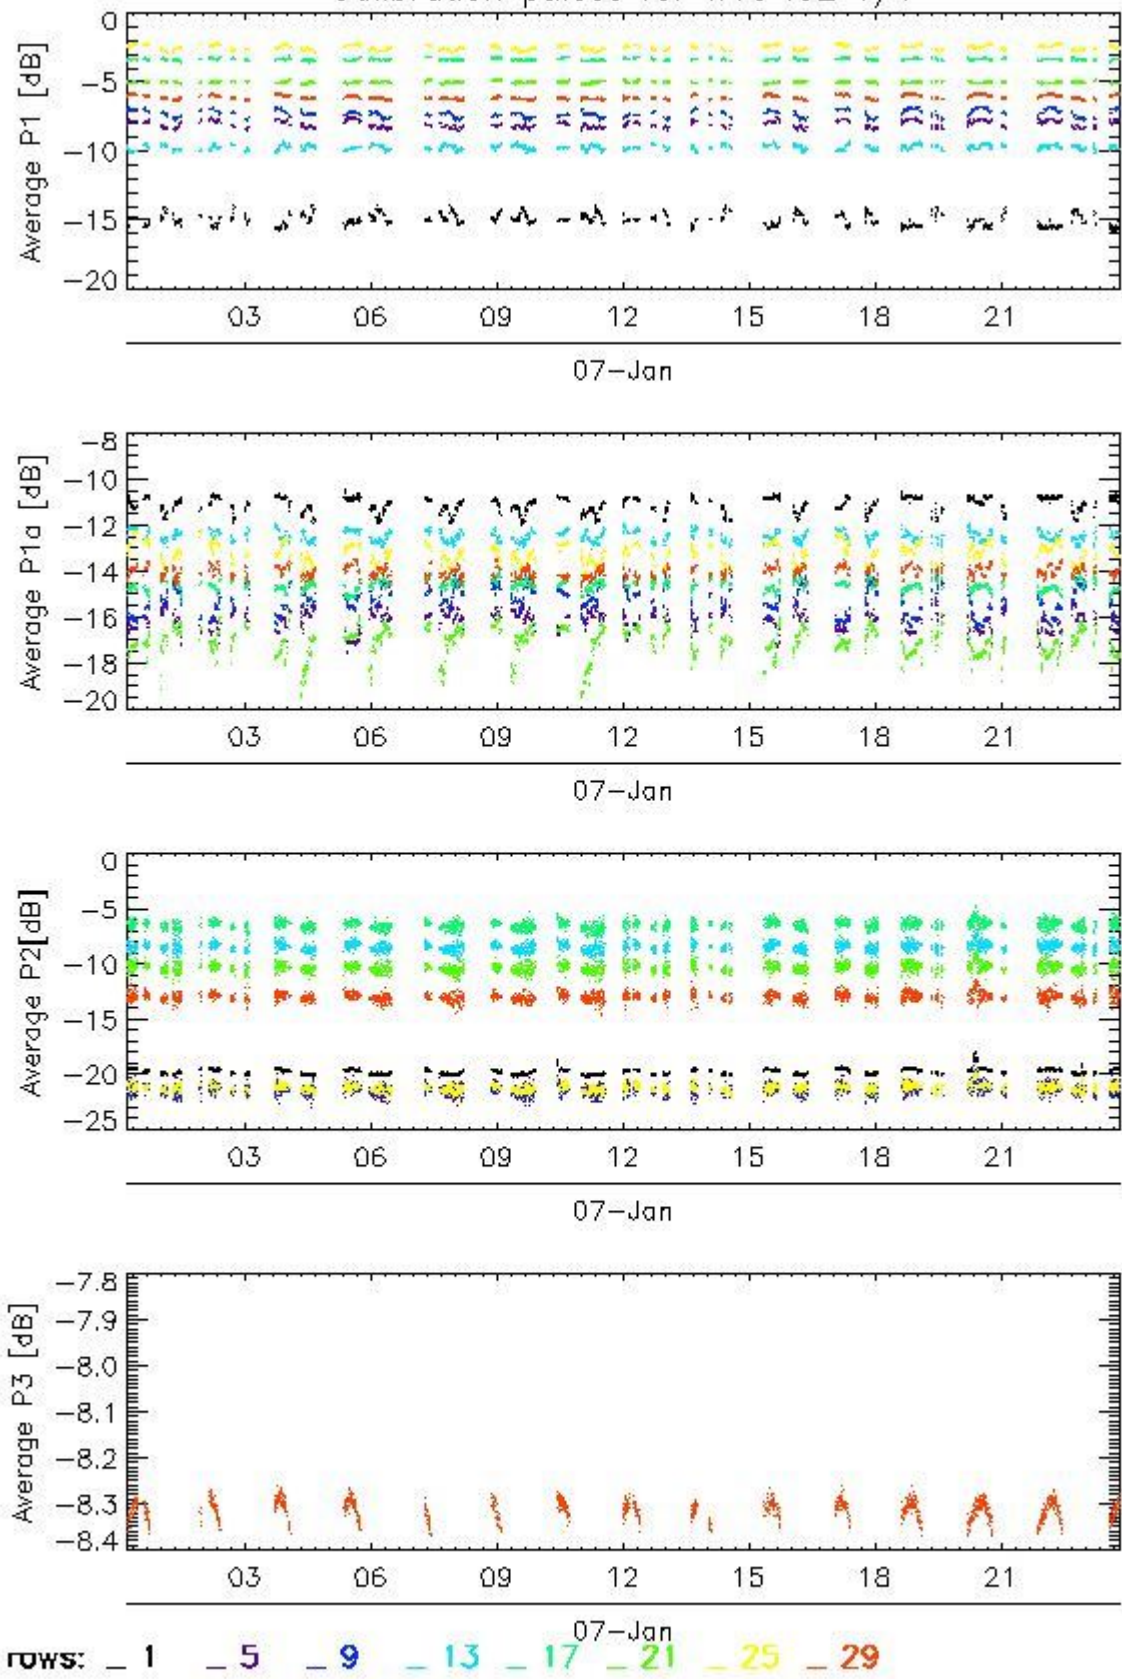


Transmit power (P1 - P1a) for WVS IS2 V/V

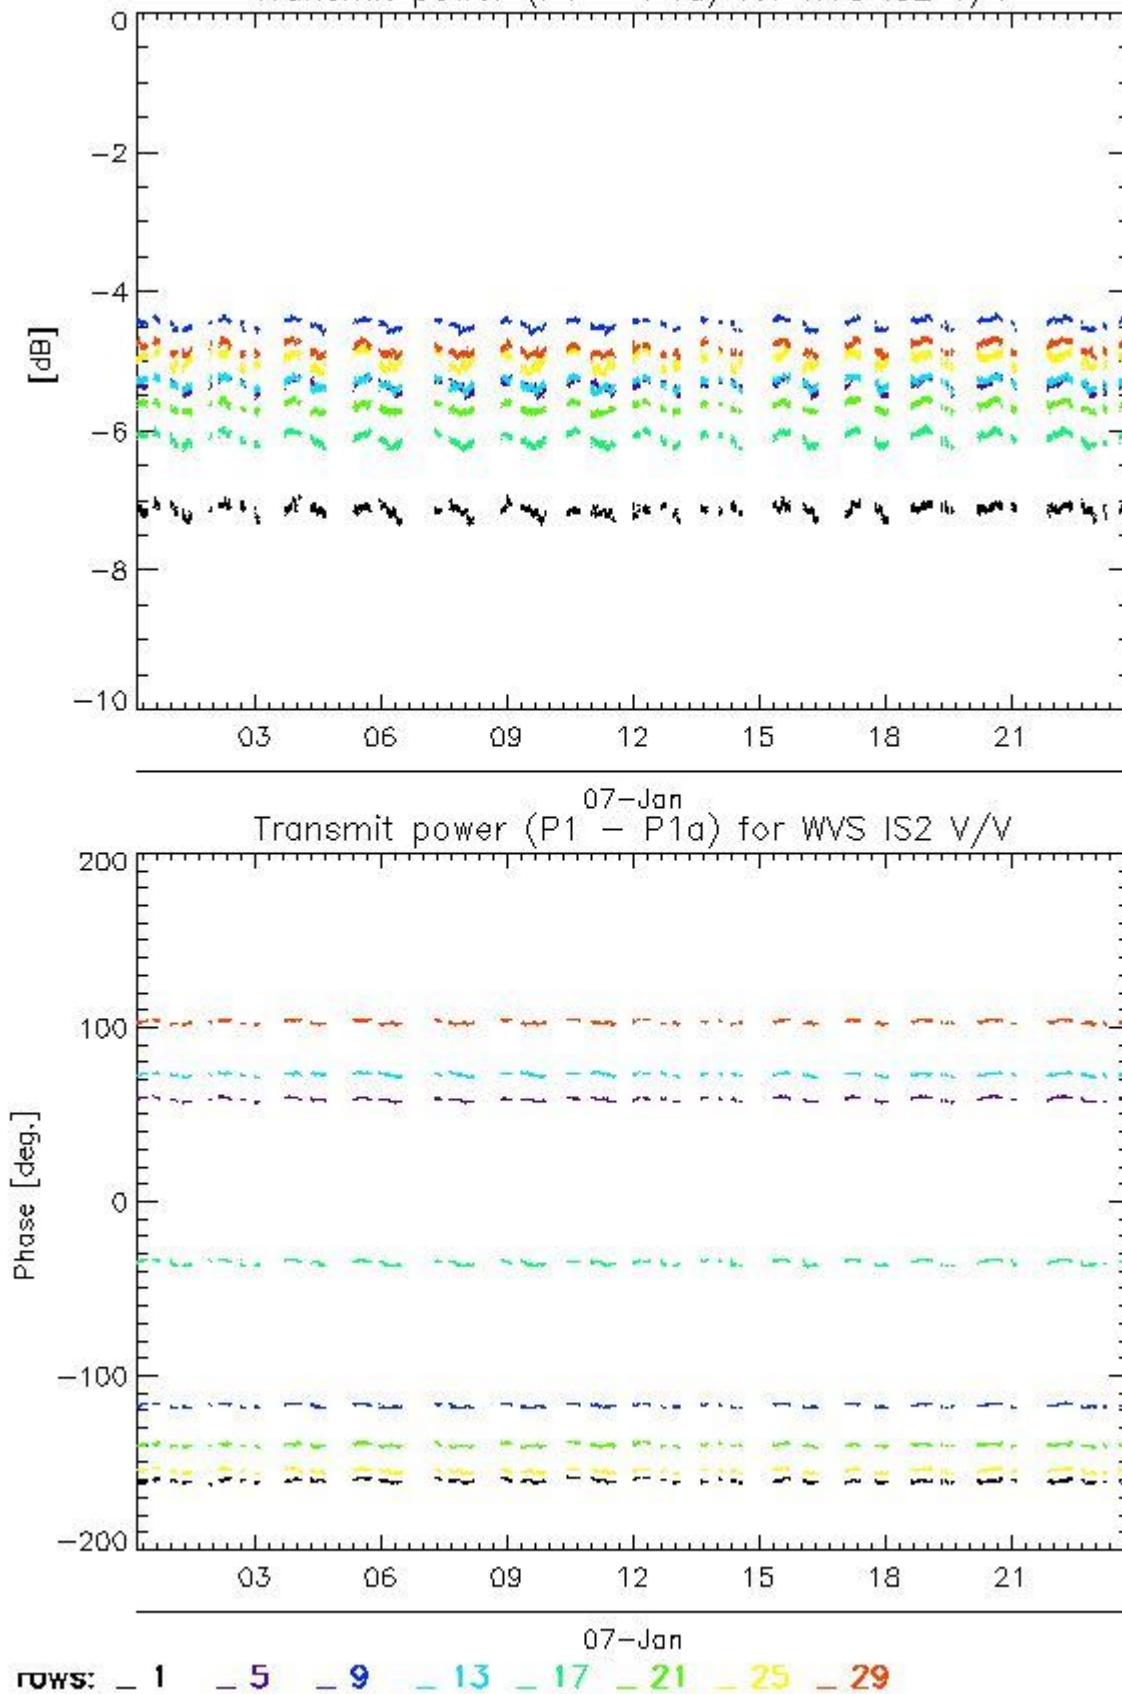

4.1.2 - All Rows Analysis for WVS IS2 V/V

[BACK TO MENU]



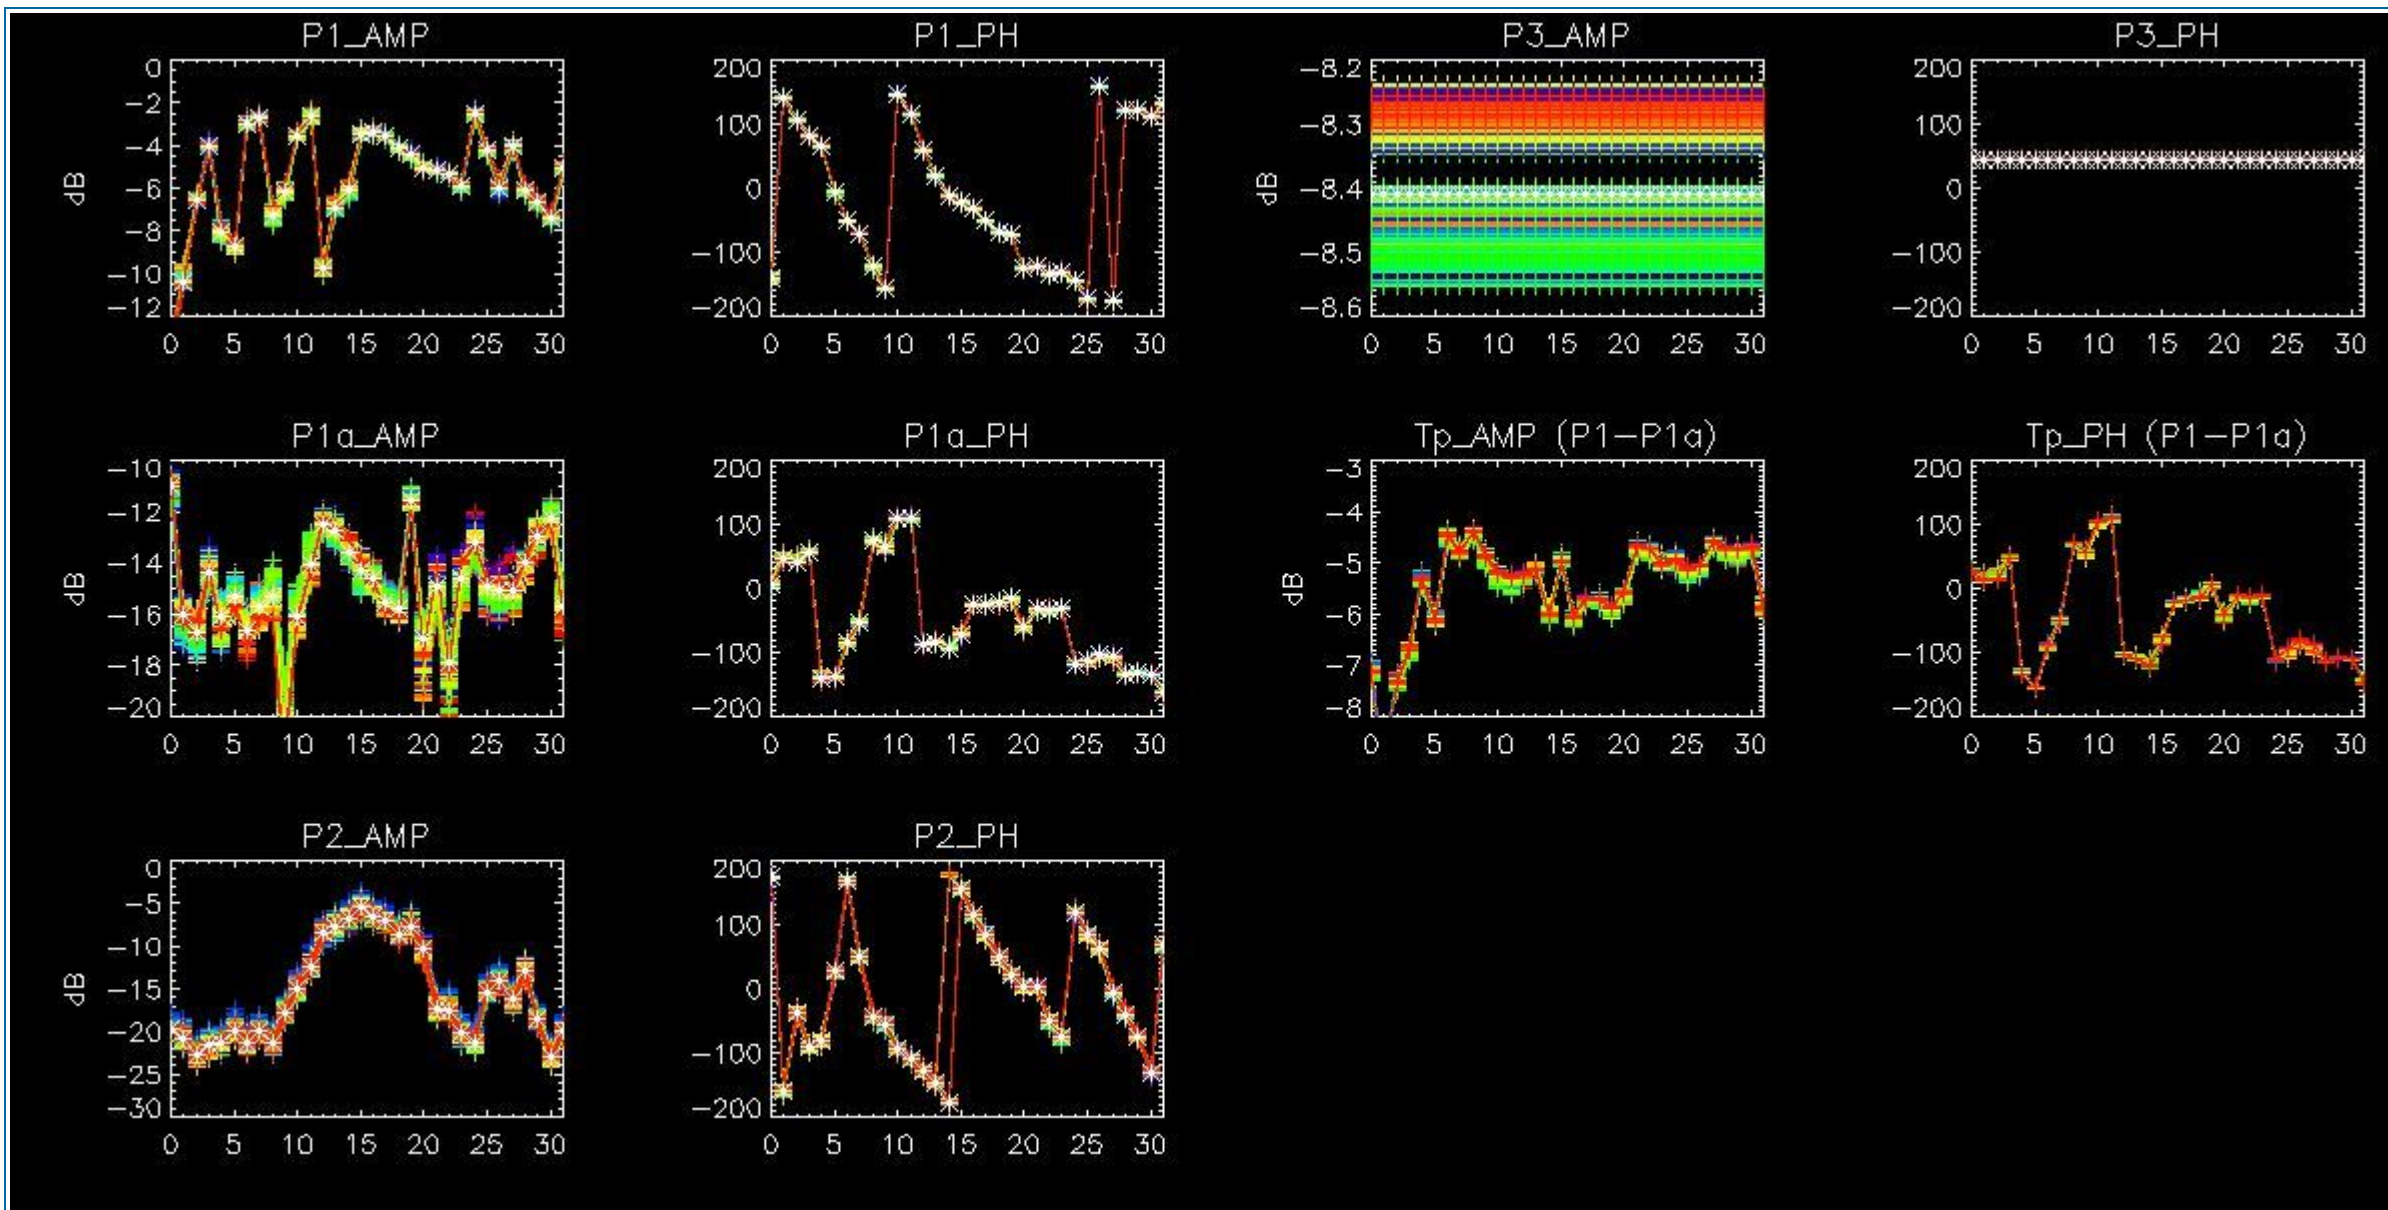

4.2 - Analysis for GM1 SS3 H/H


4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for GM1 SS3 H/H

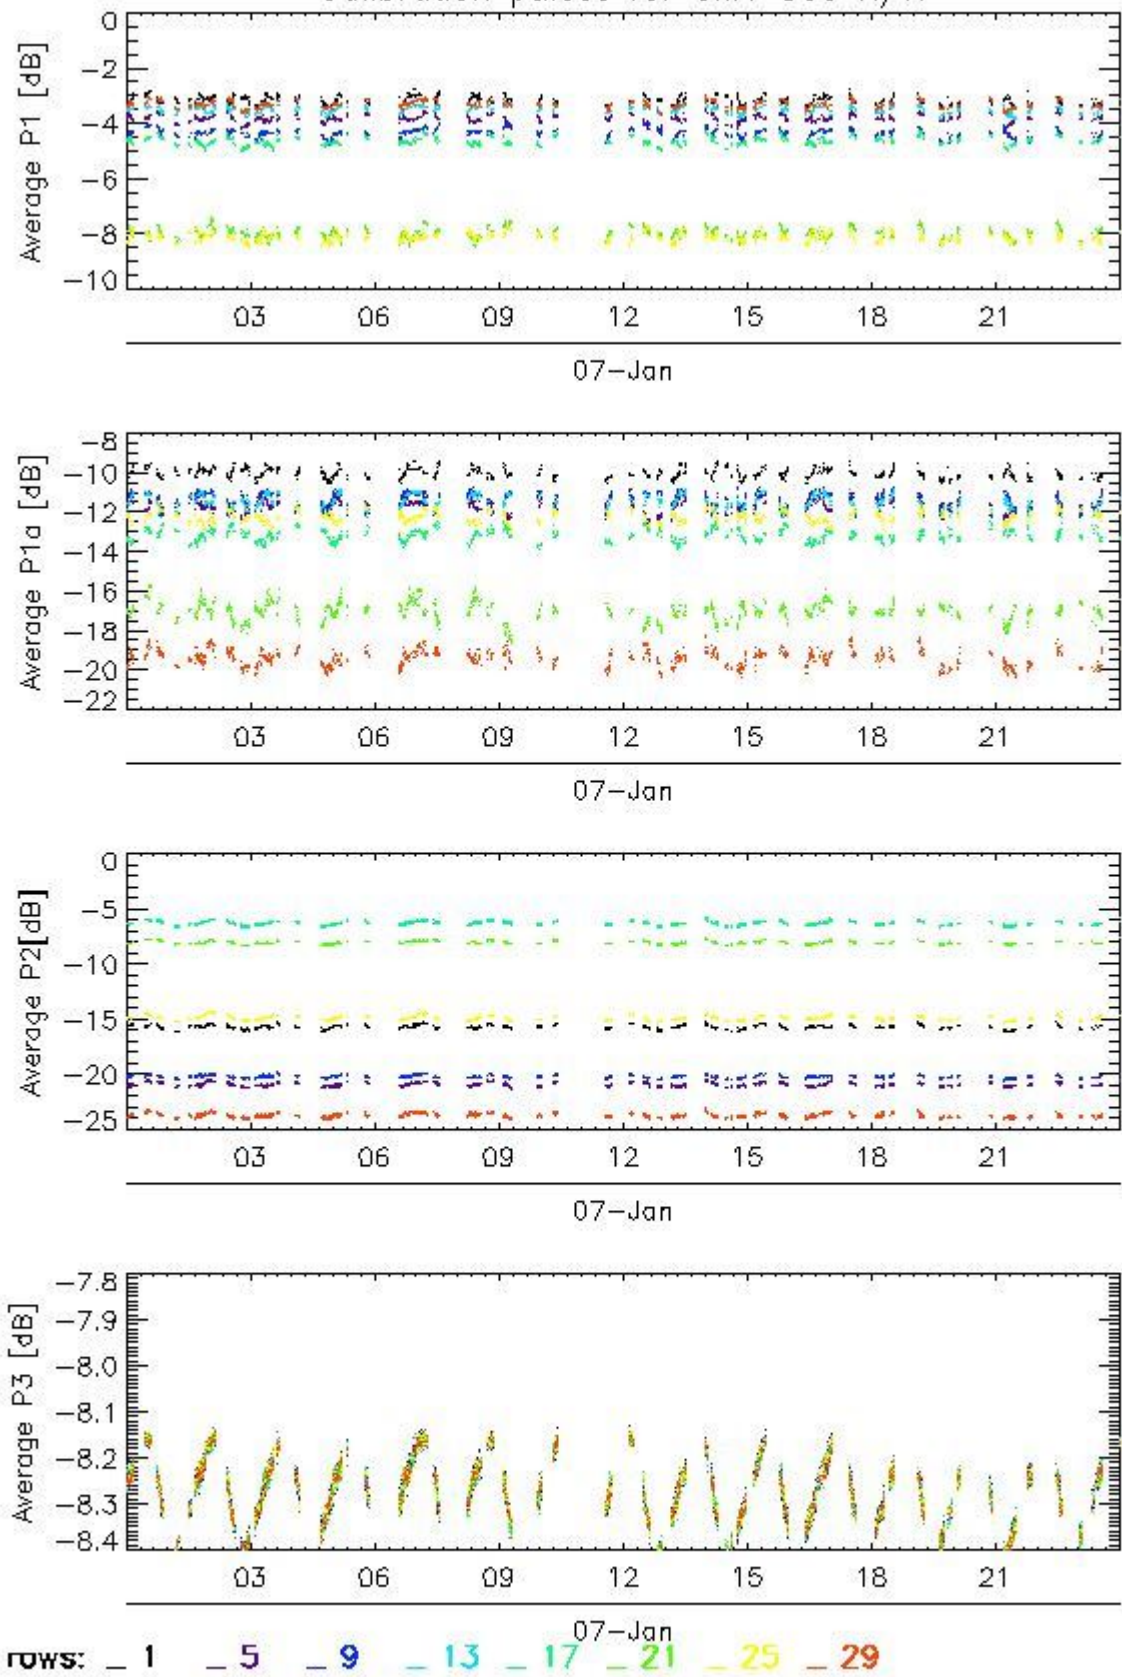


Transmit power (P1 - P1a) for GM1 SS3 H/H

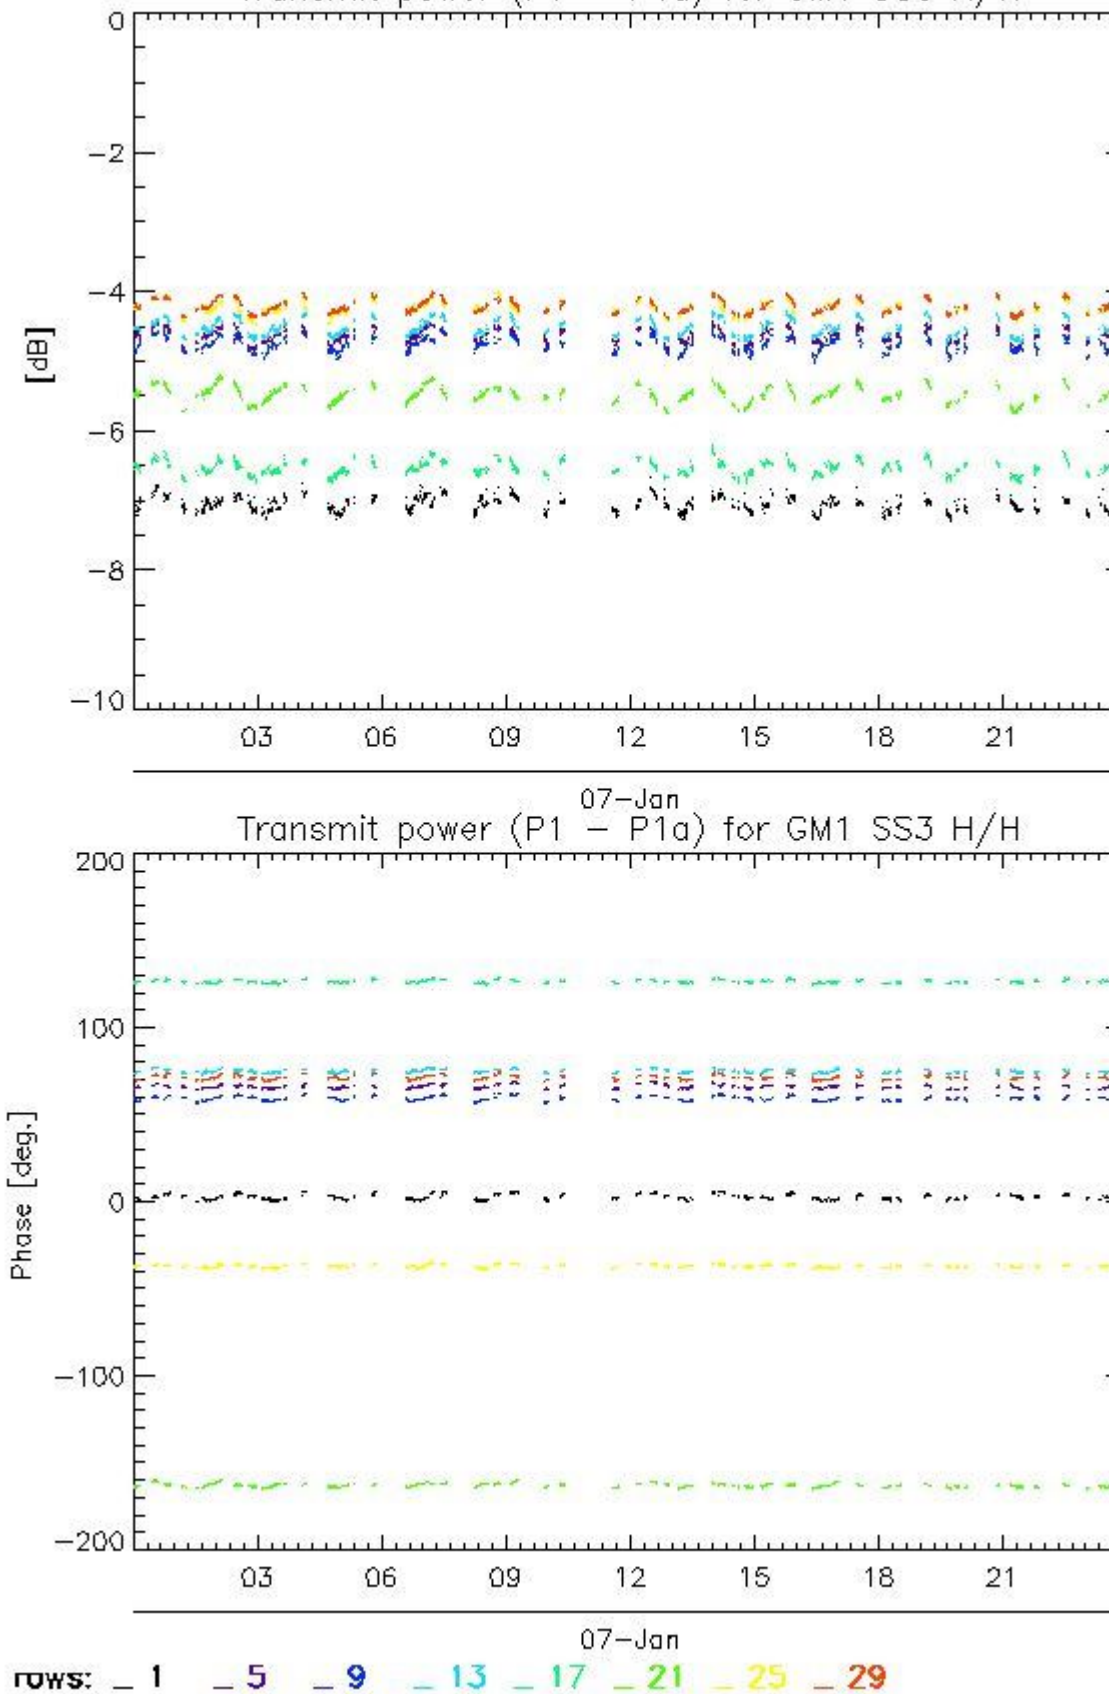

4.2.2 - All Rows Analysis for GM1 SS3 H/H

[BACK TO MENU]



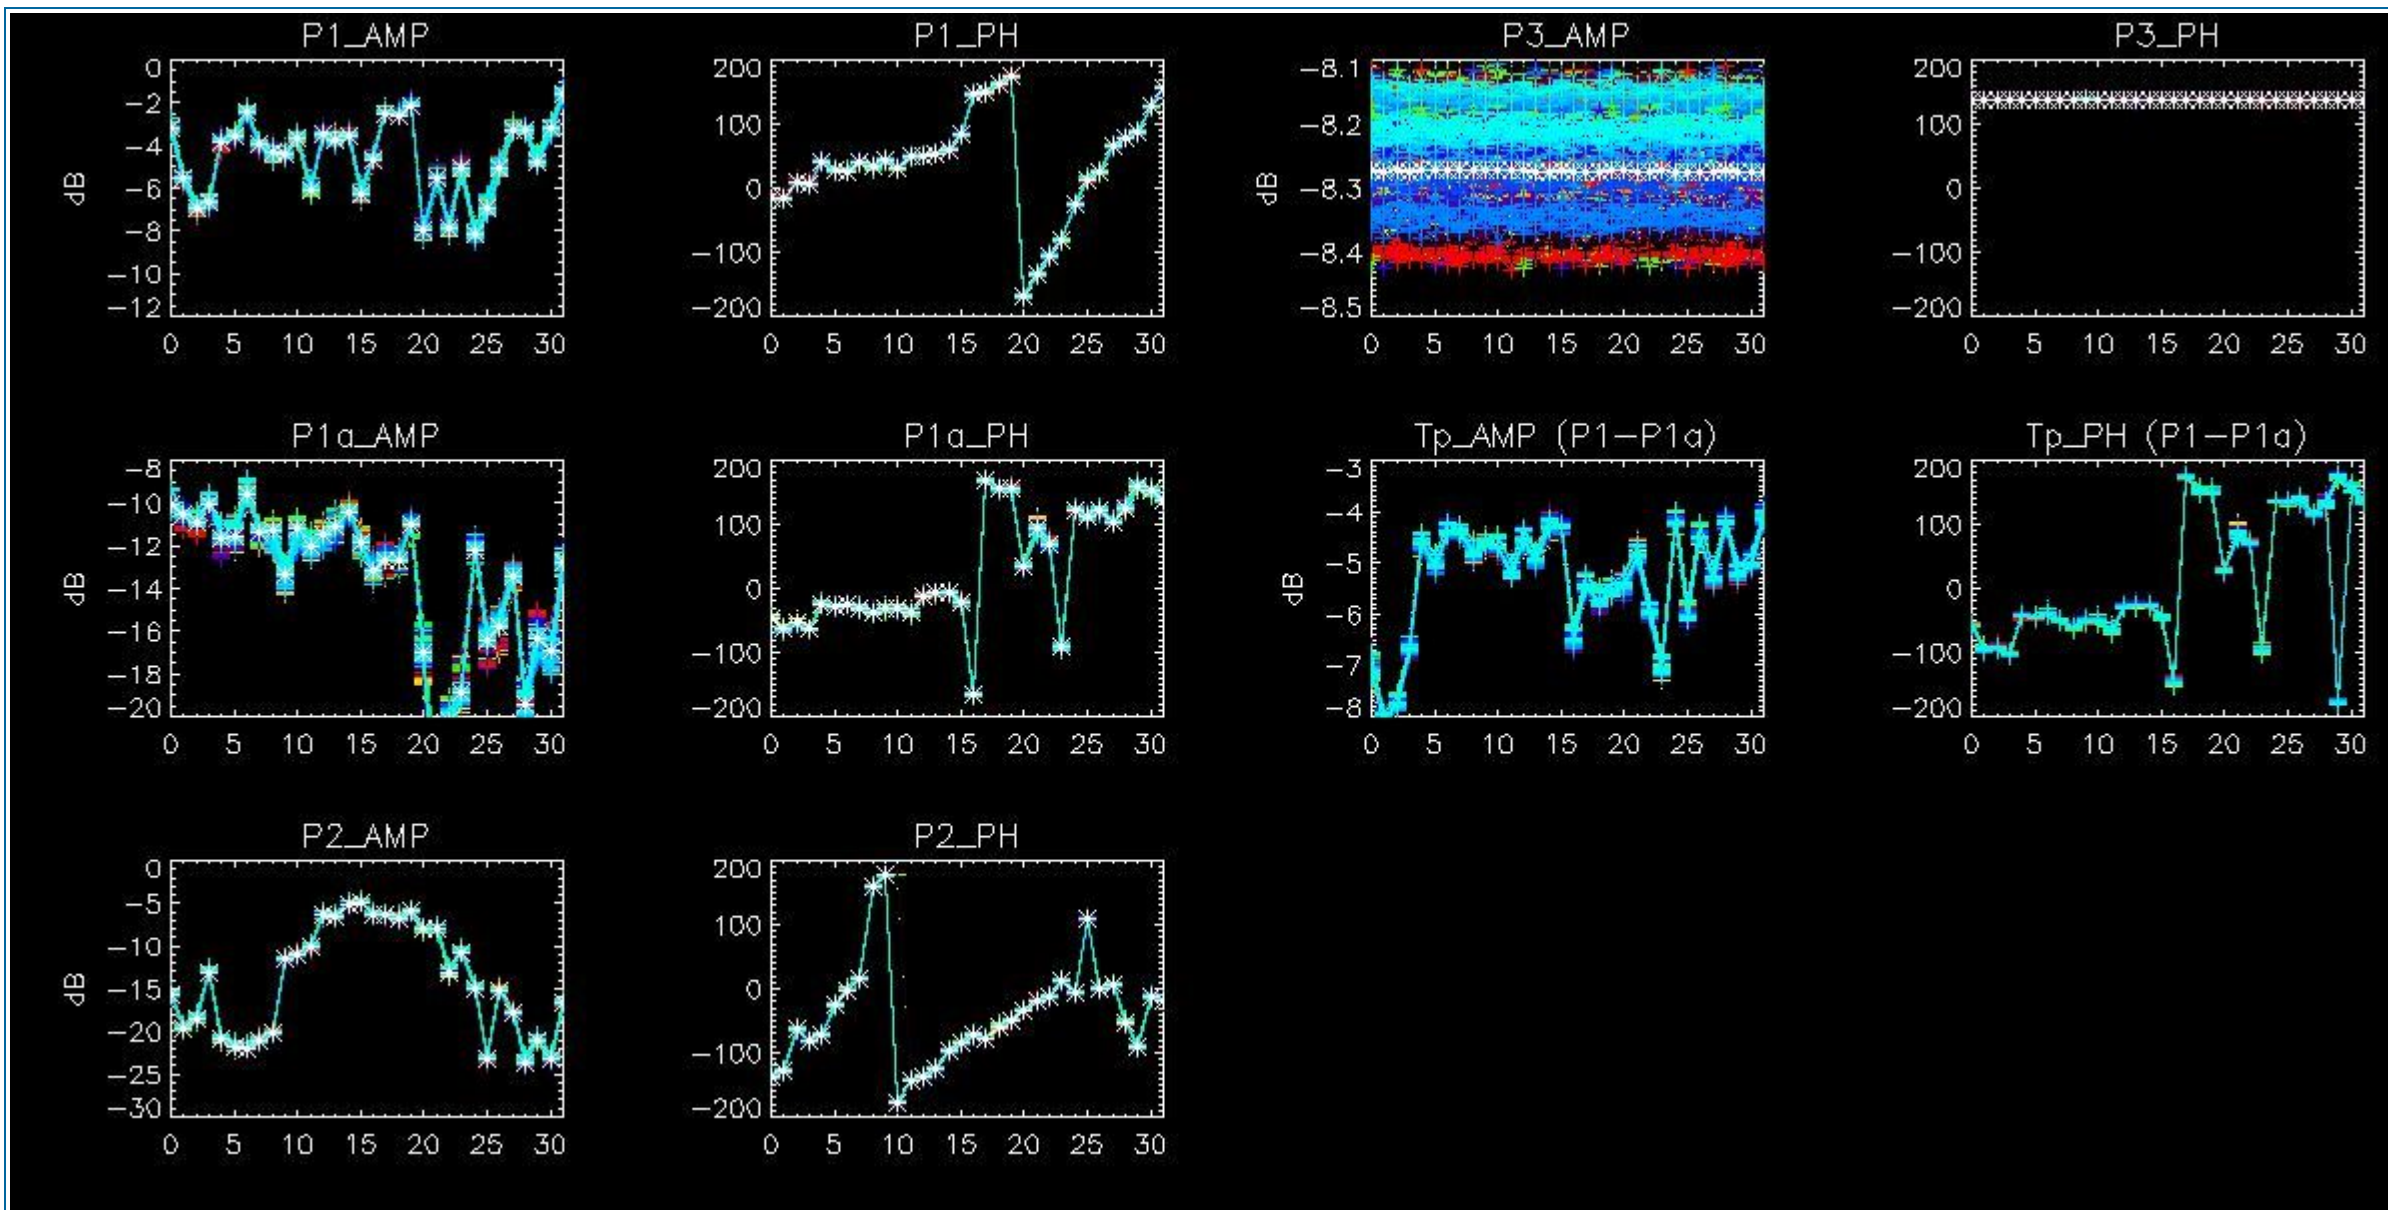


5 - DOPPLER ANALYSIS

5.1 - Analysis for WVS IS2 V/V

5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]




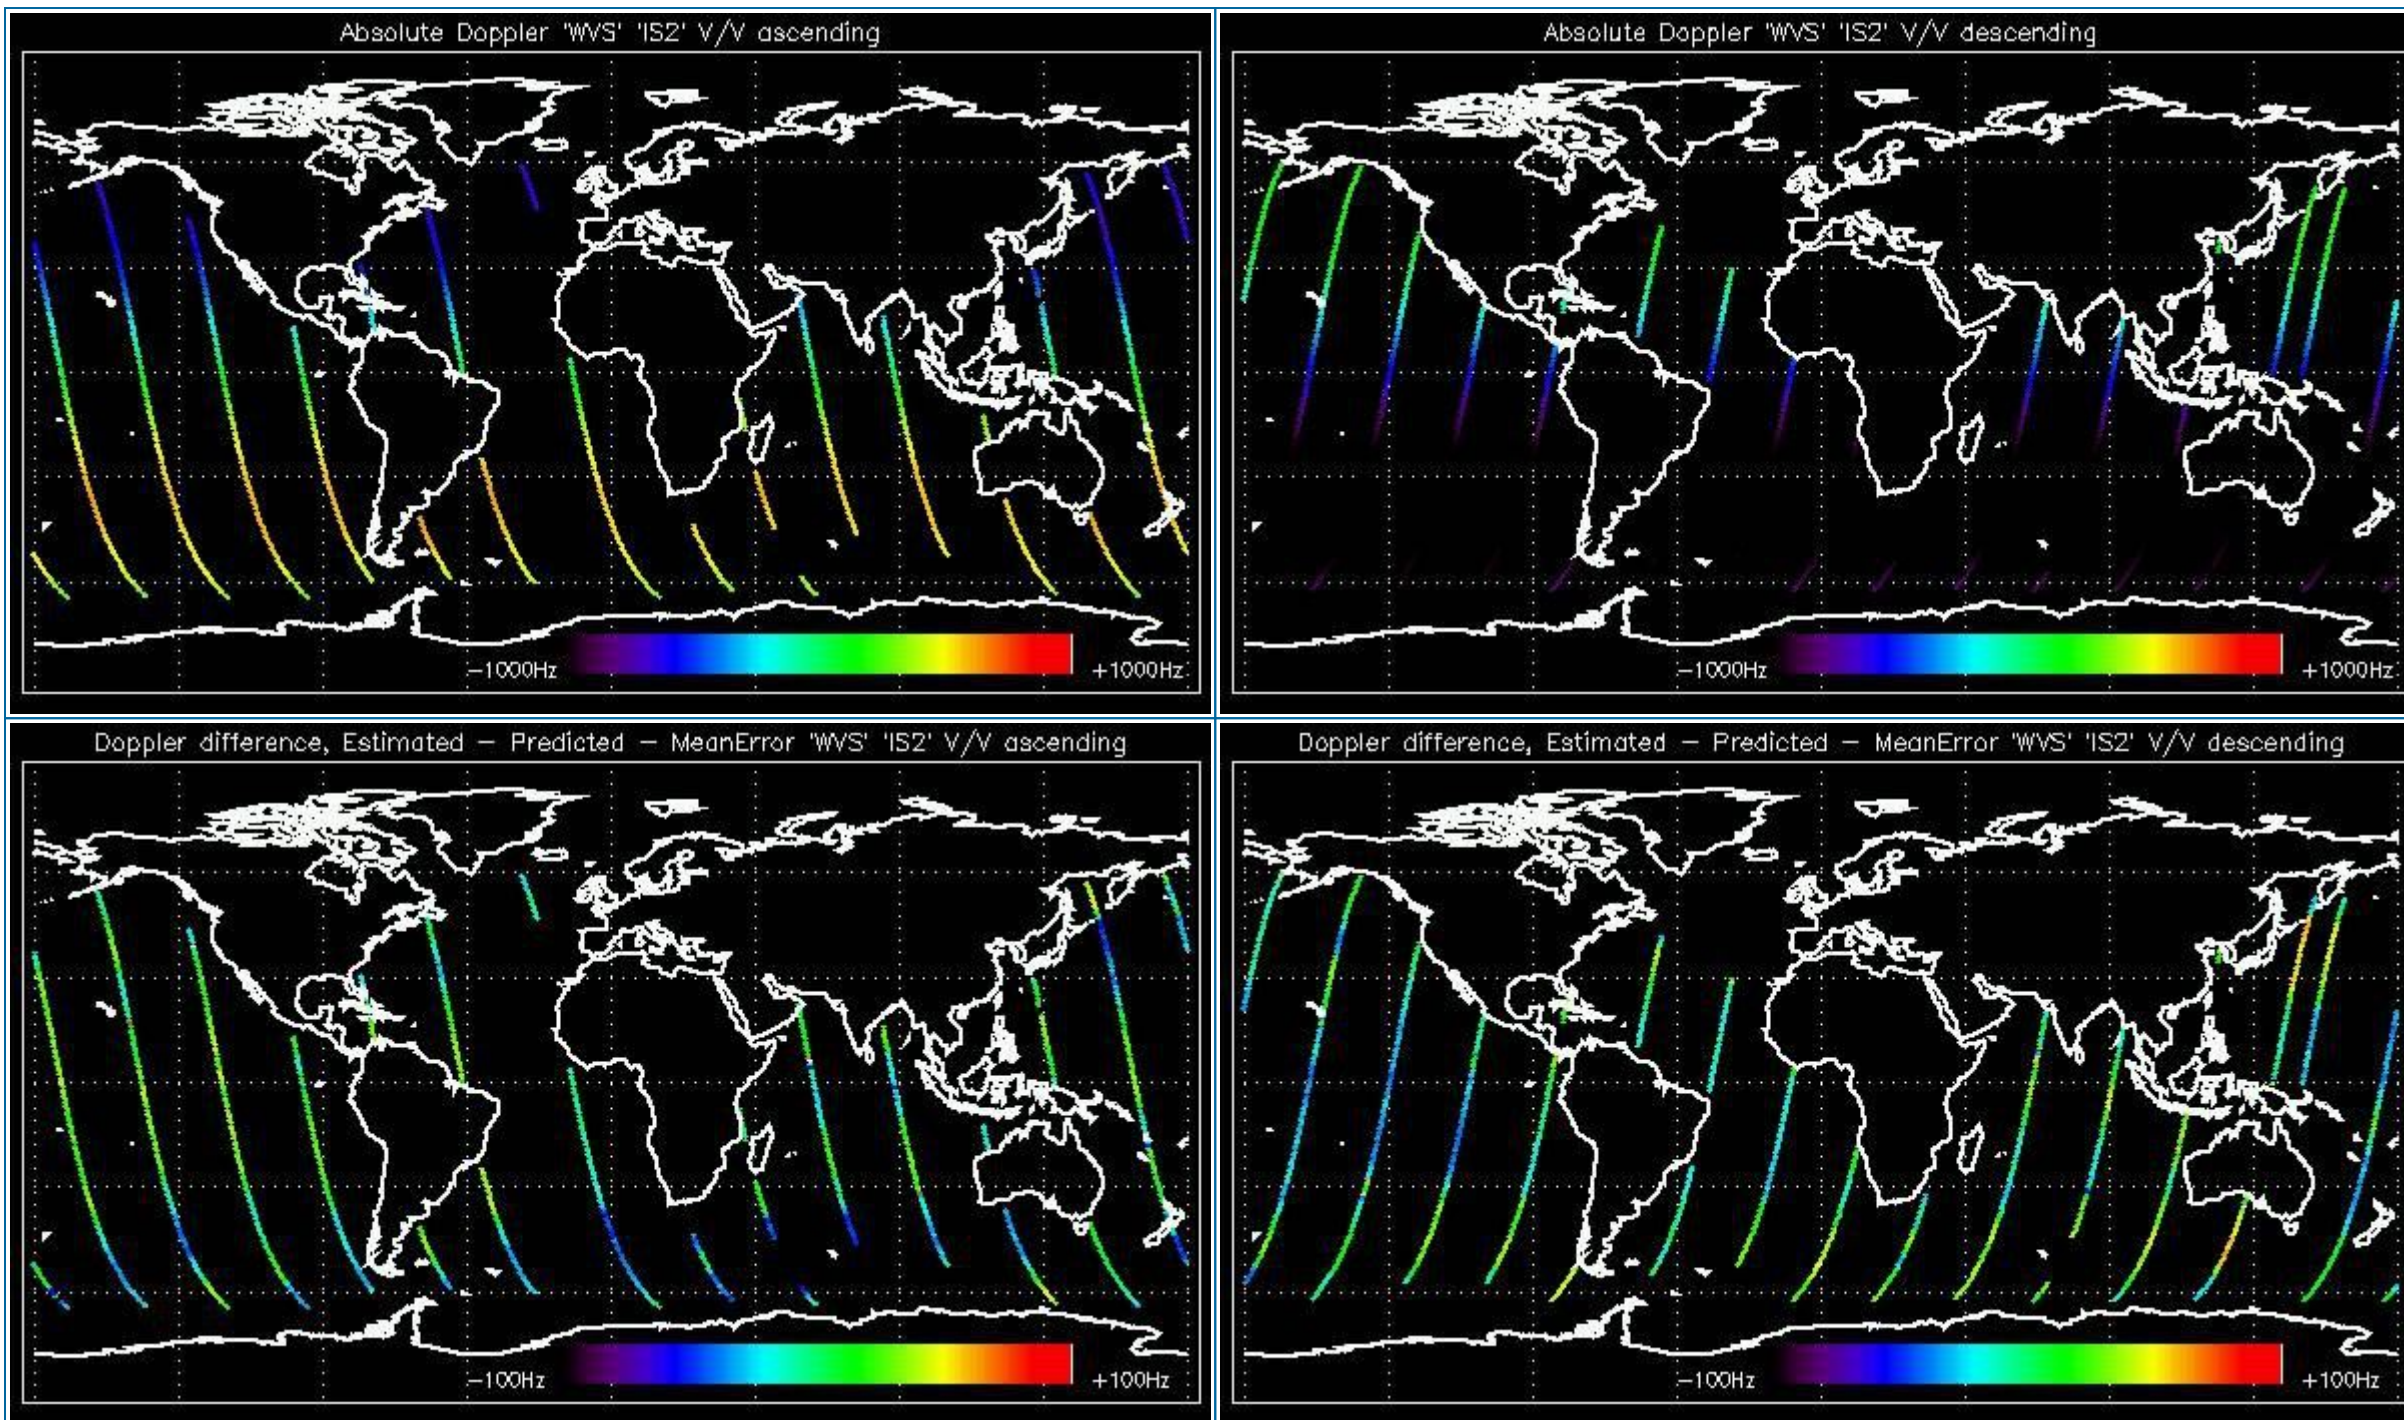

5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



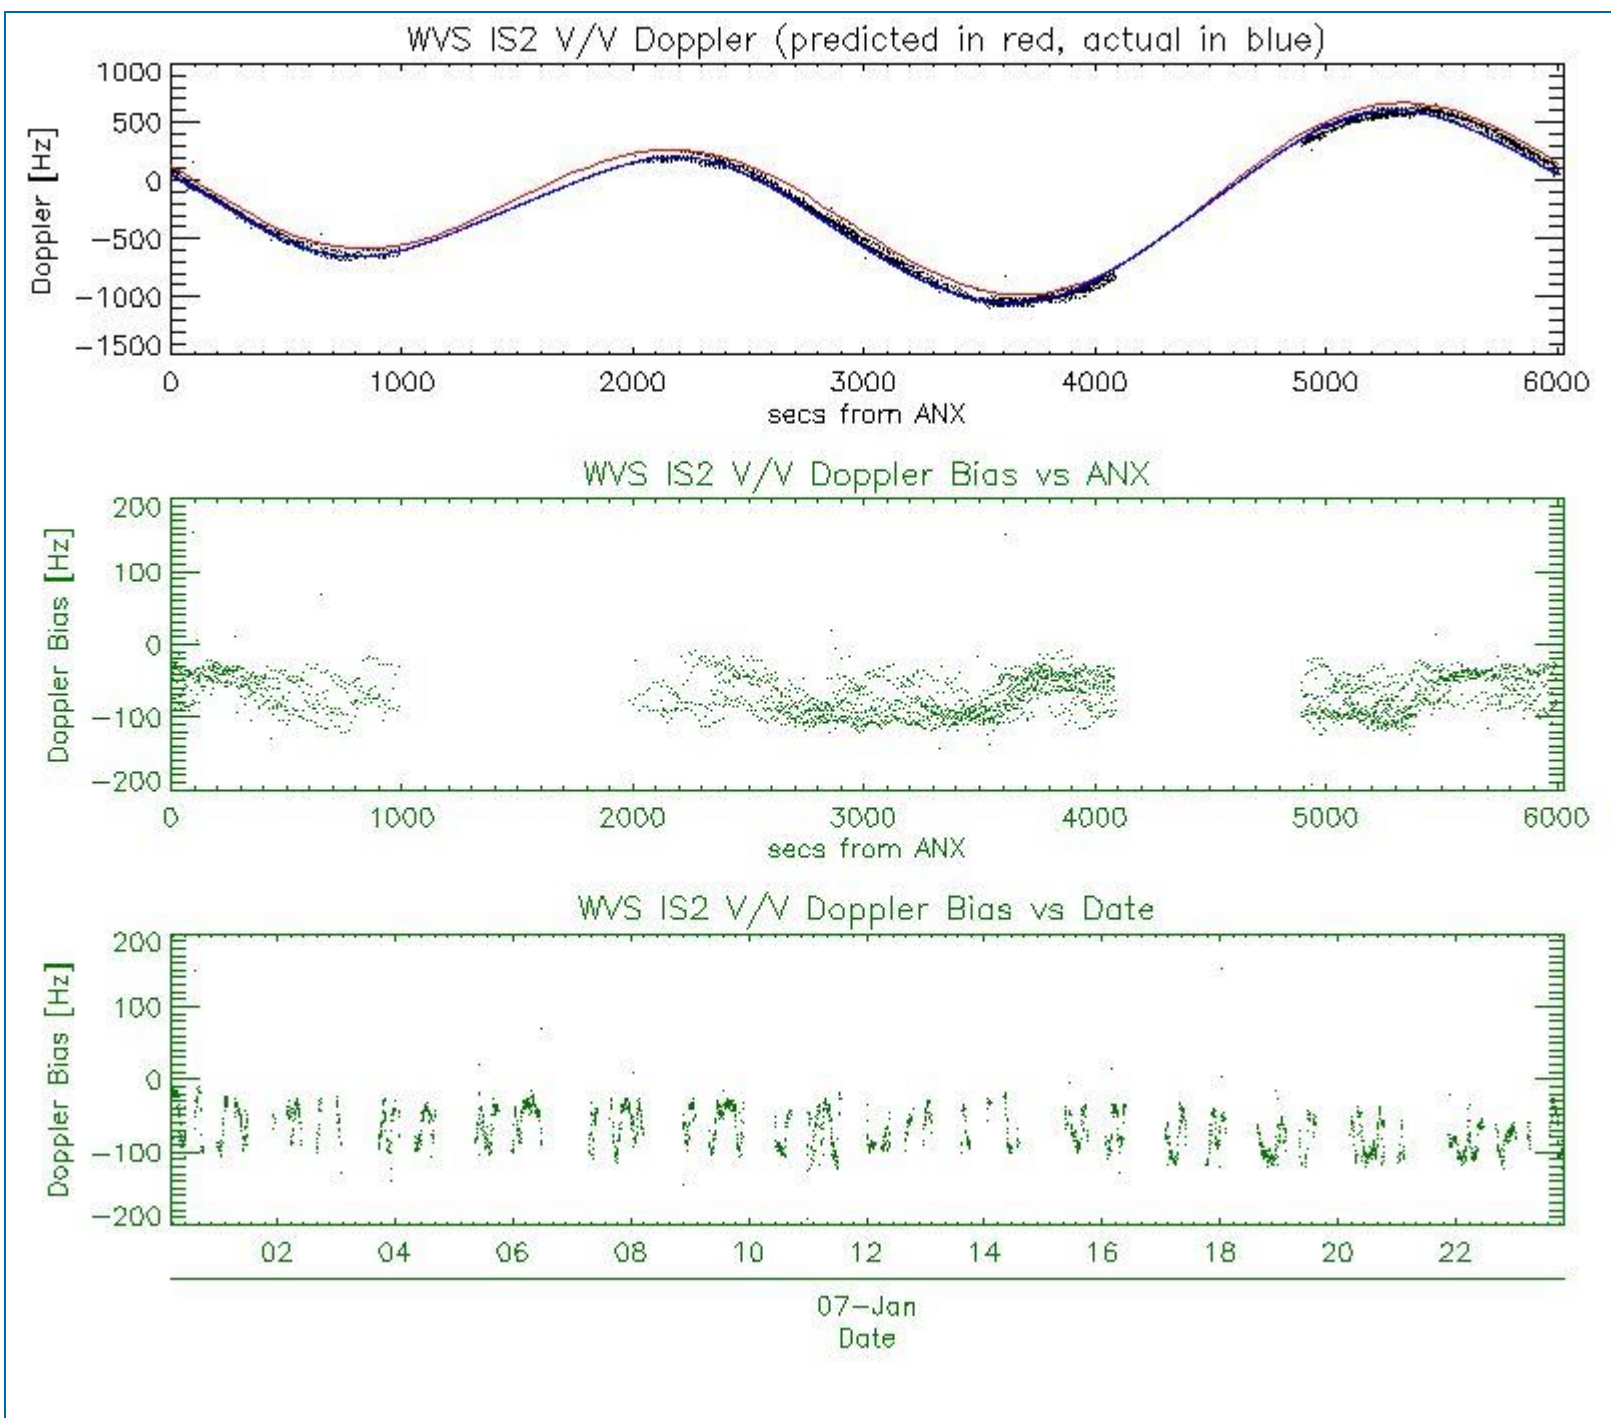


5.2 - Analysis for GM1 SS1 H/H

5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




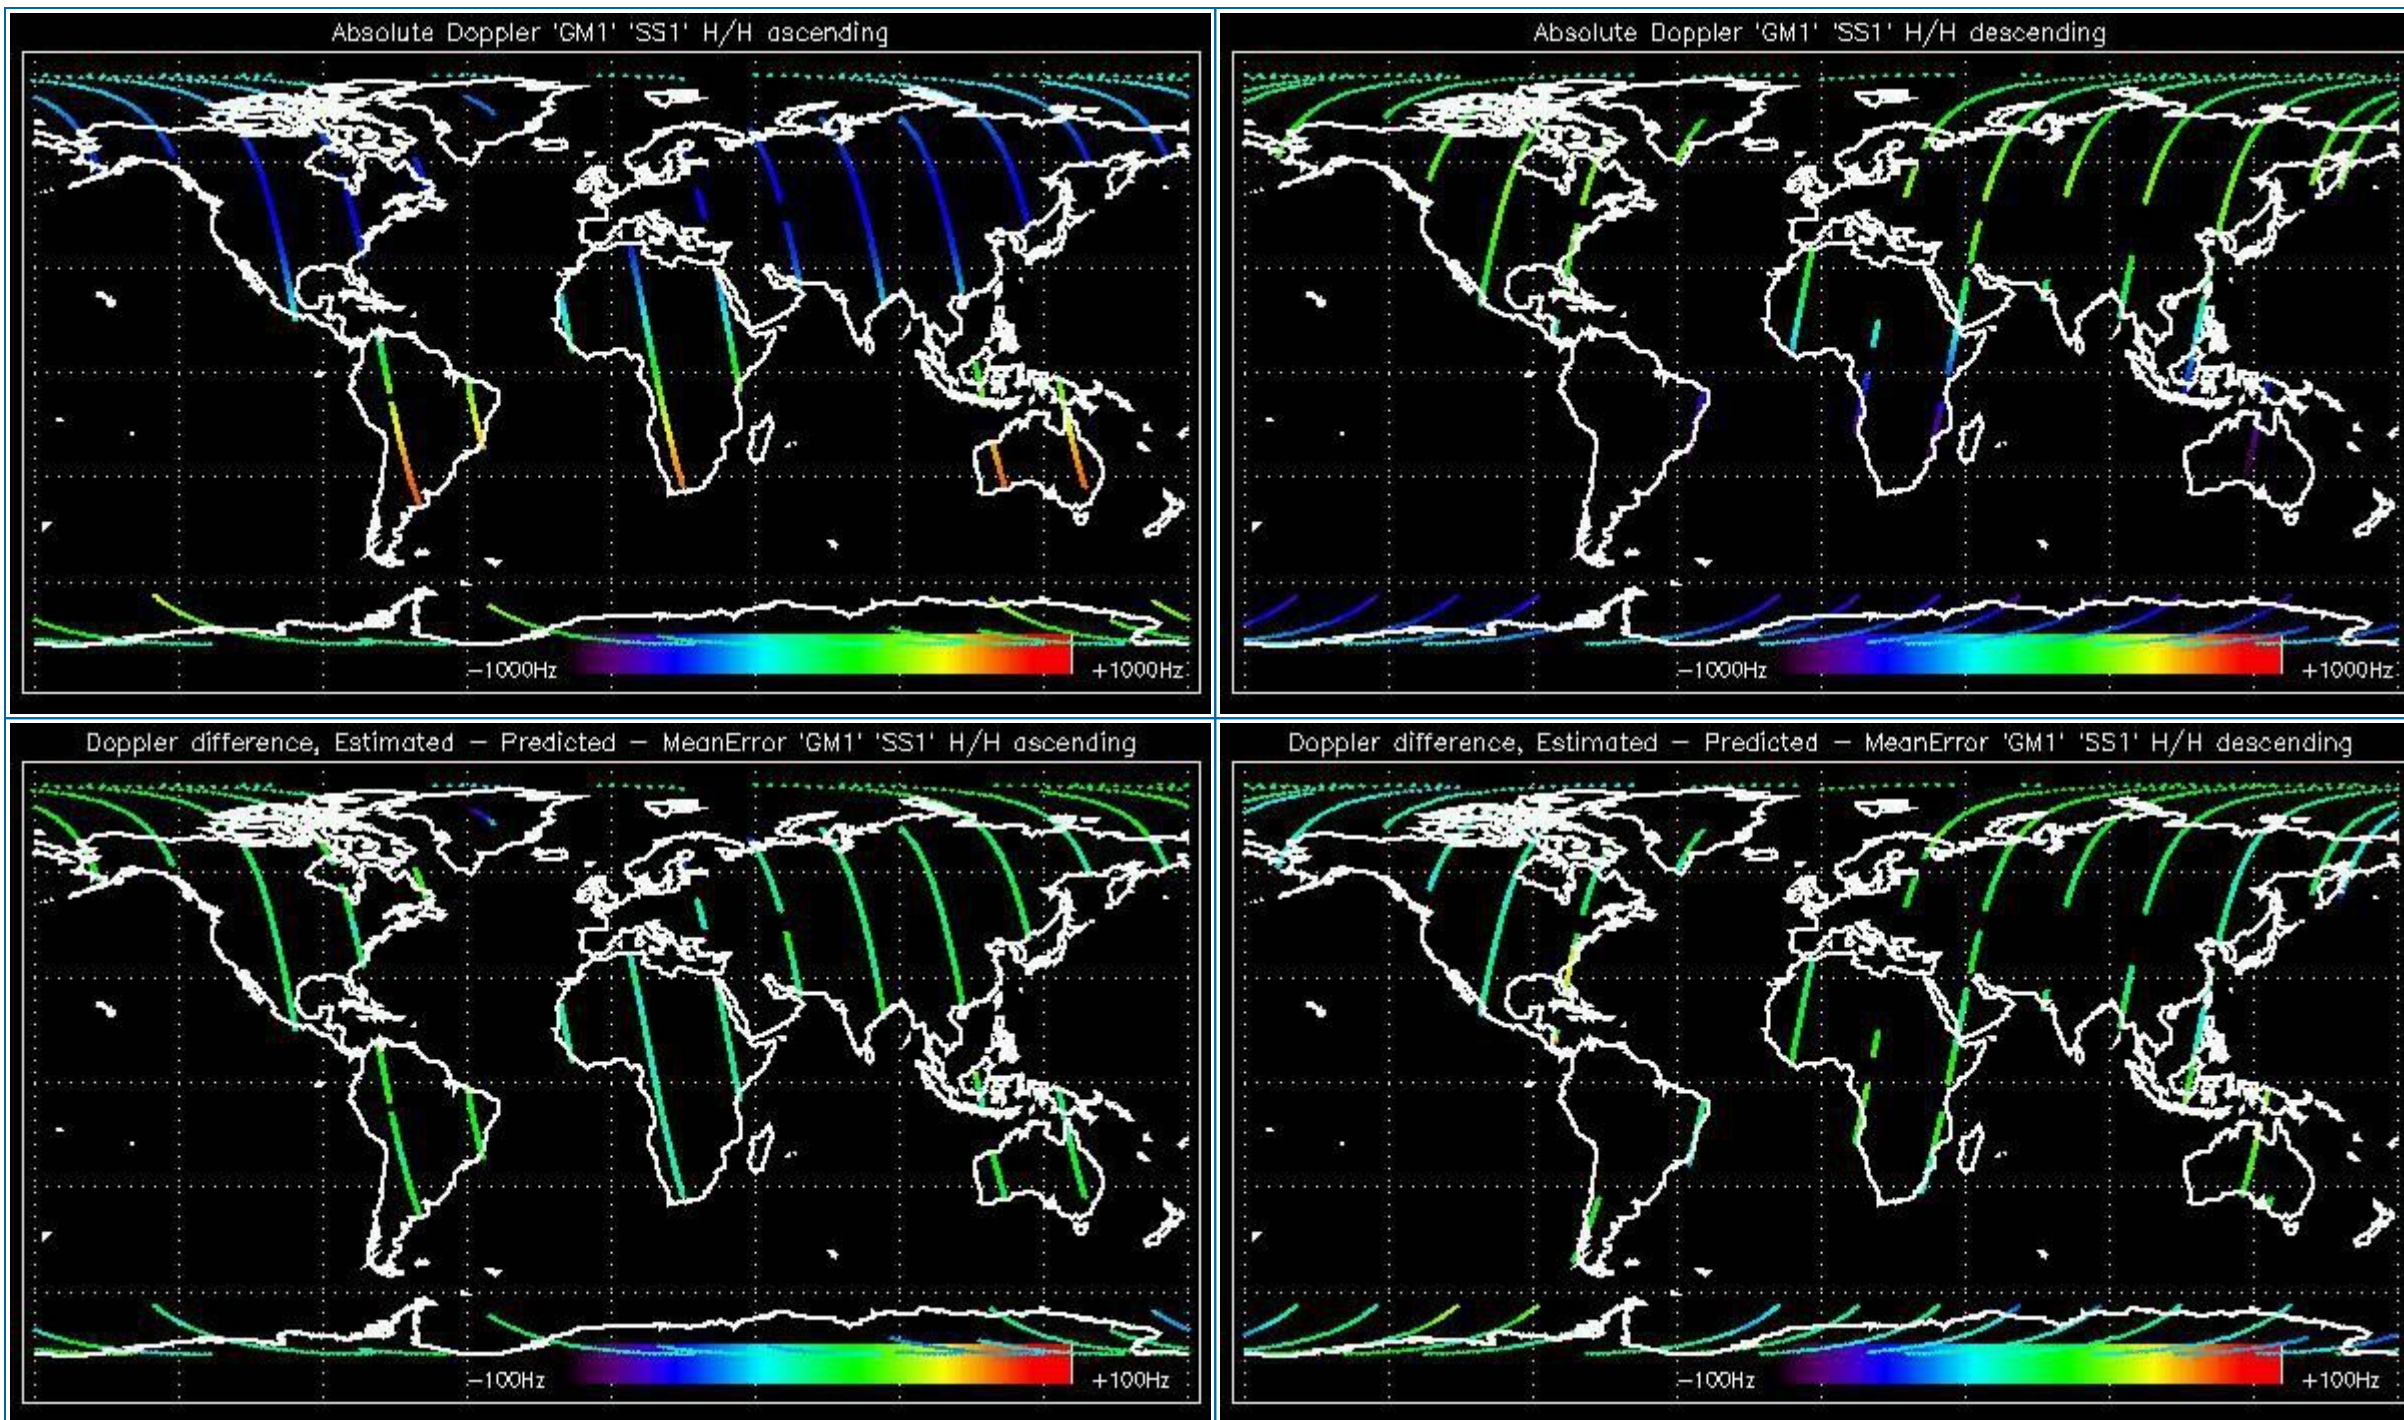

5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




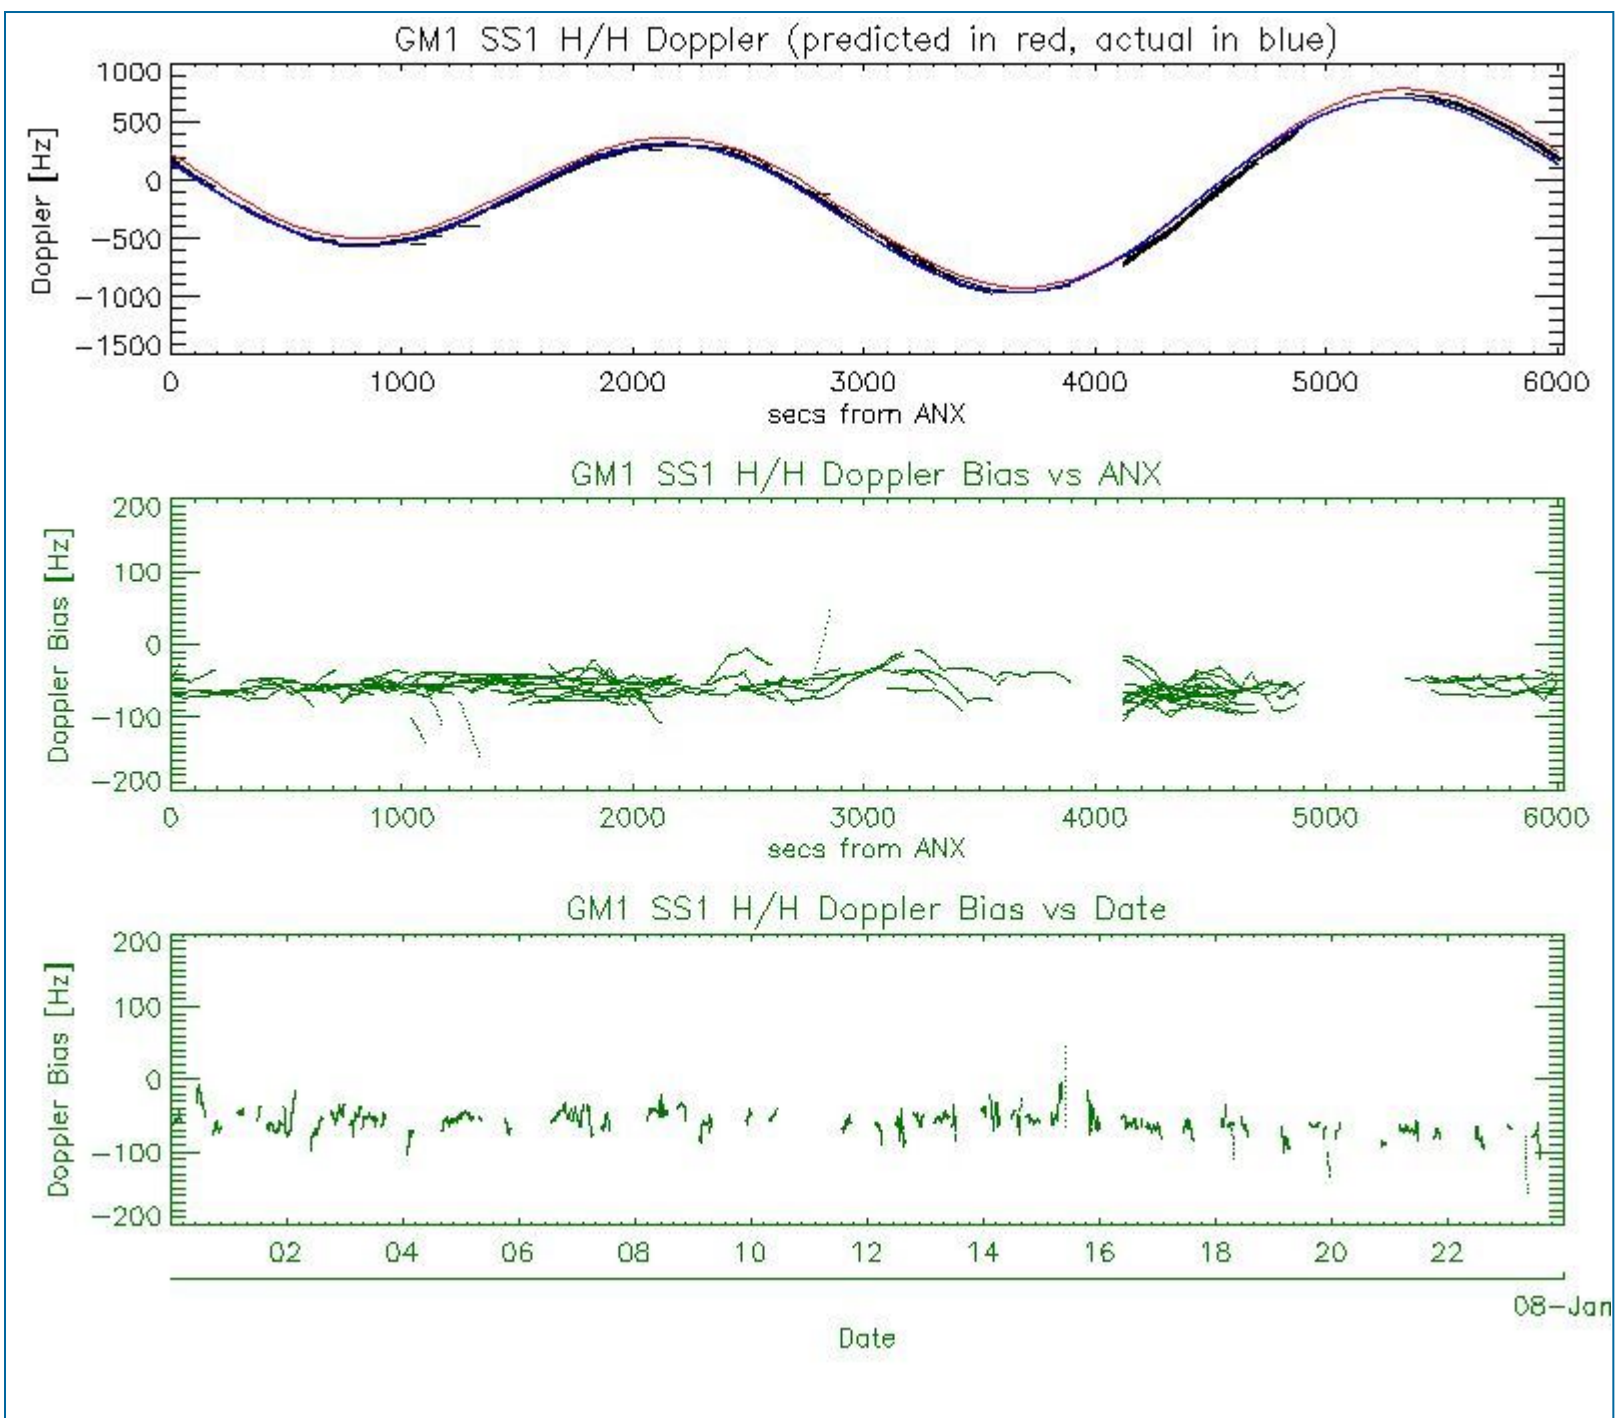

5.3 - Doppler JUMPS Analysis for WSM

[BACK TO MENU]



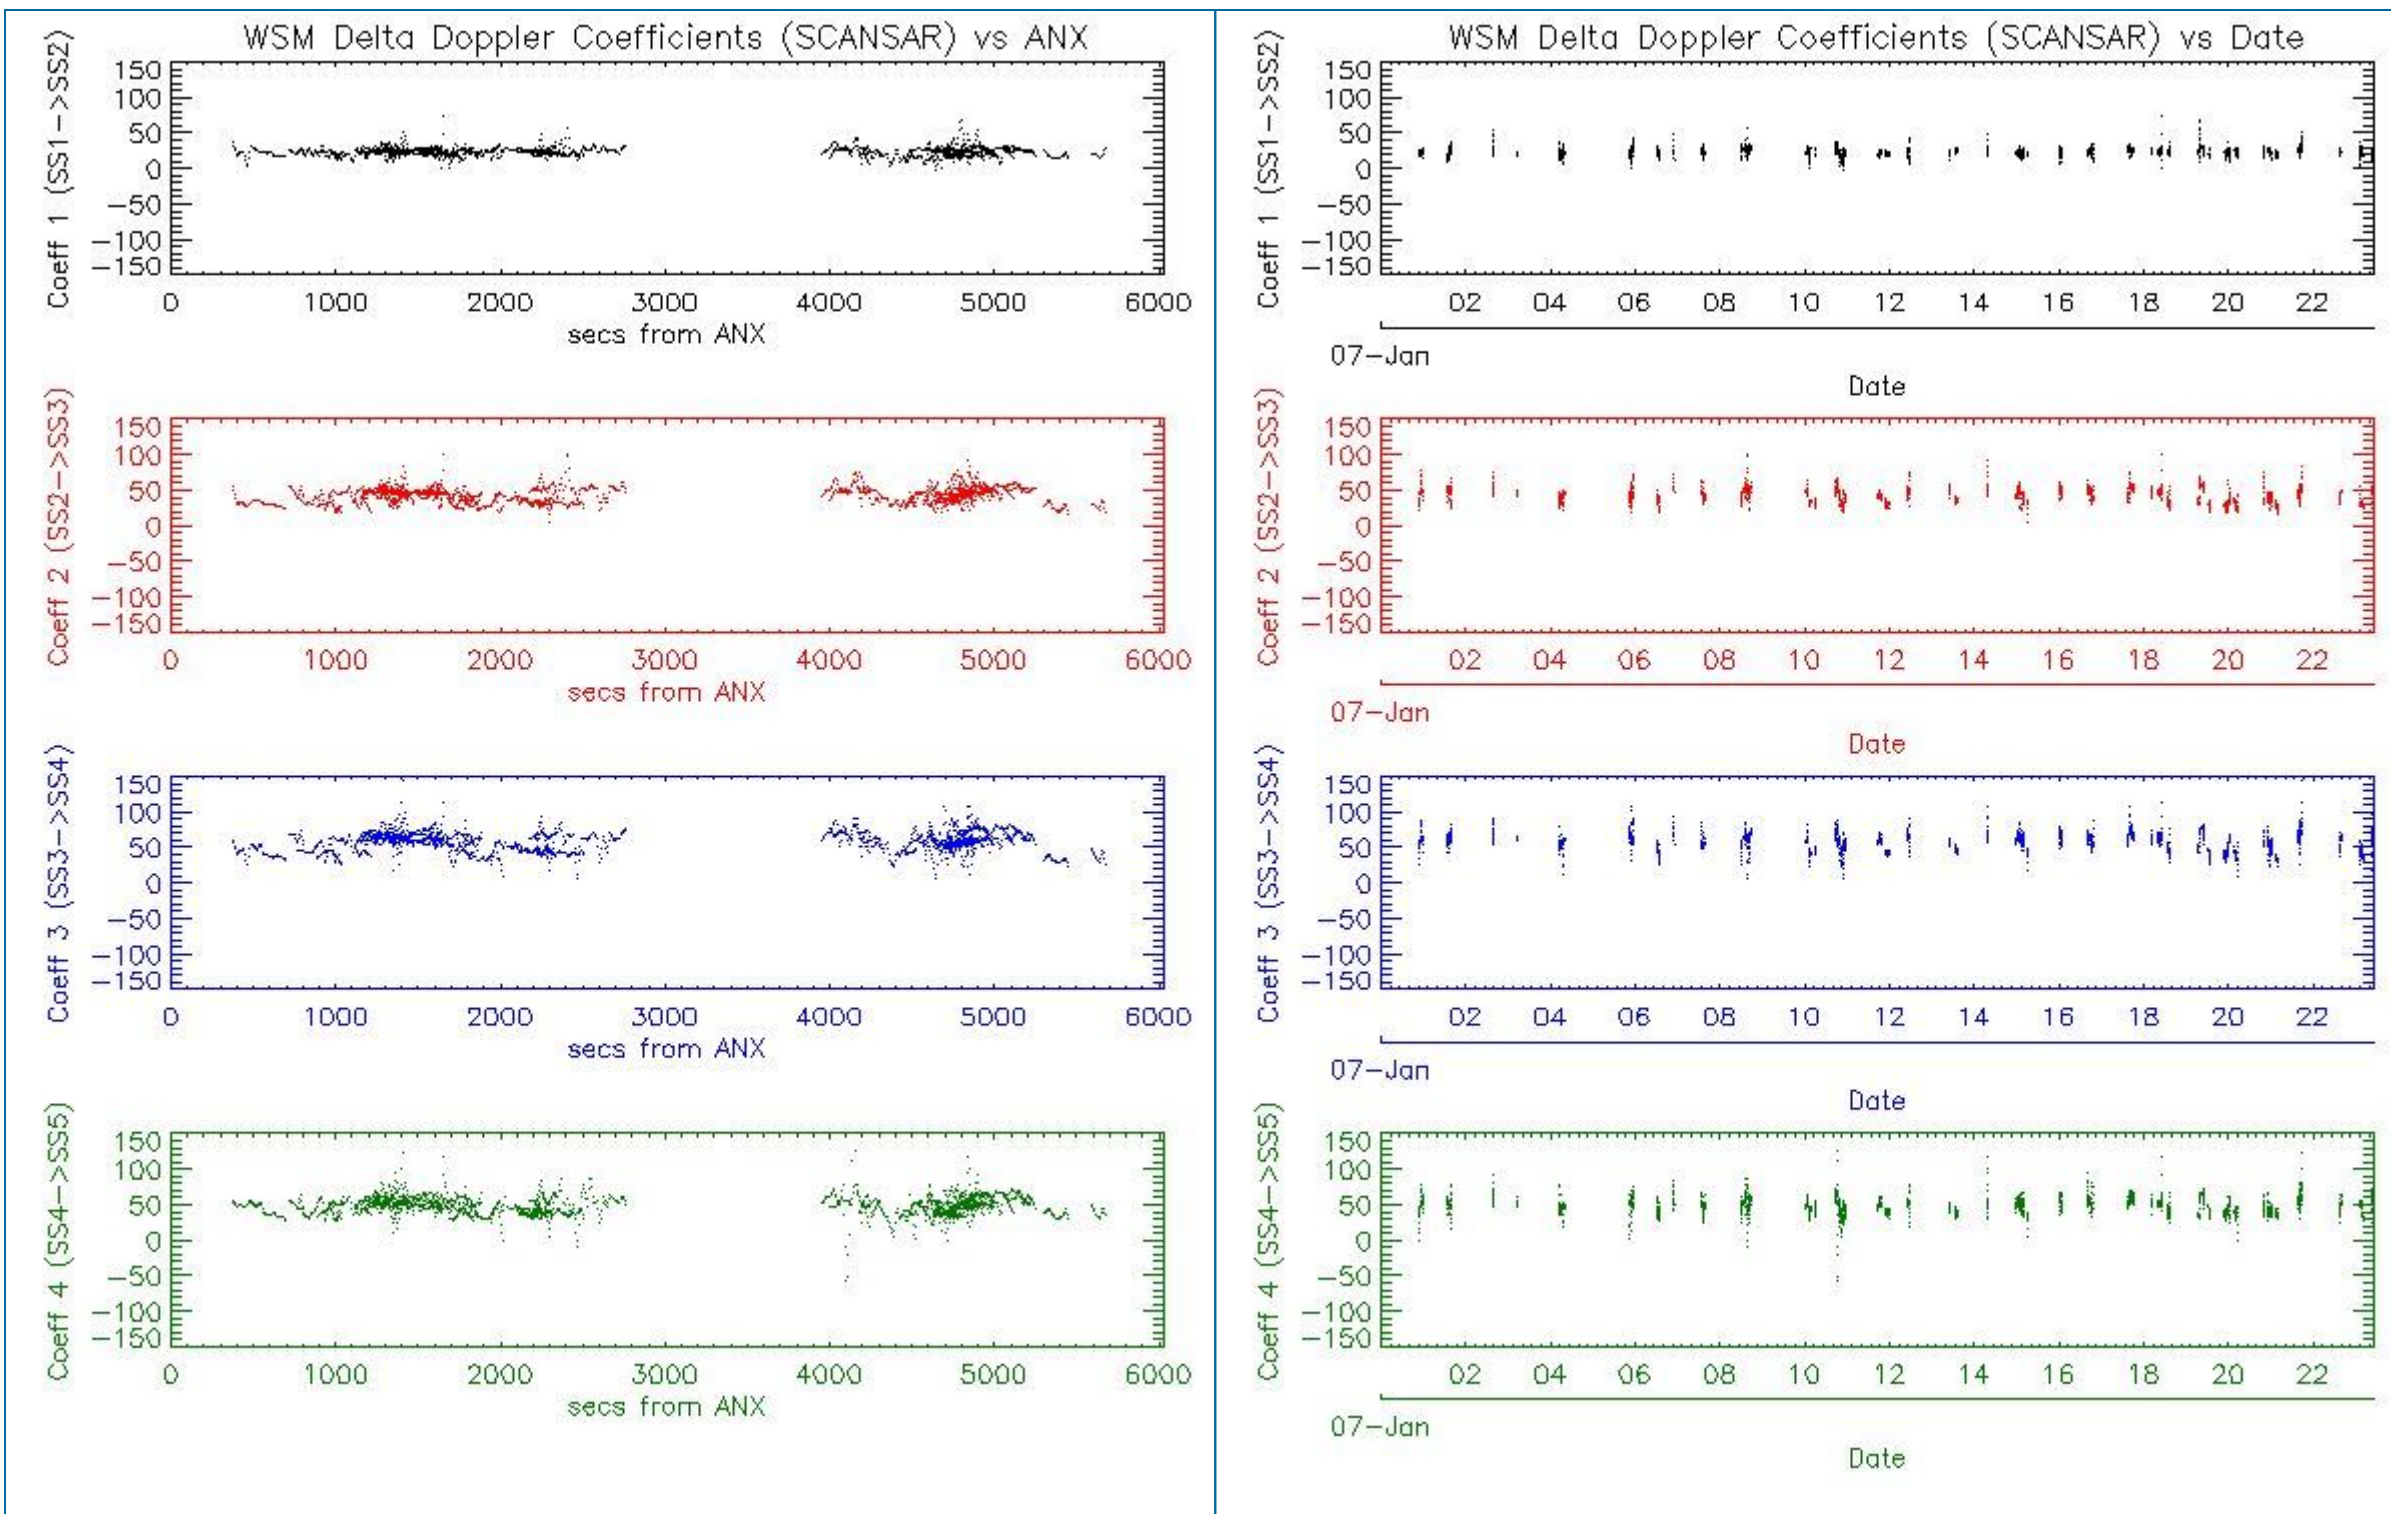



6 - CHIRP ANALYSIS

6.1 - Analysis for WSM SS1 H/H

6.1.1 - ScaleFactor

[[BACK TO MENU](#)]





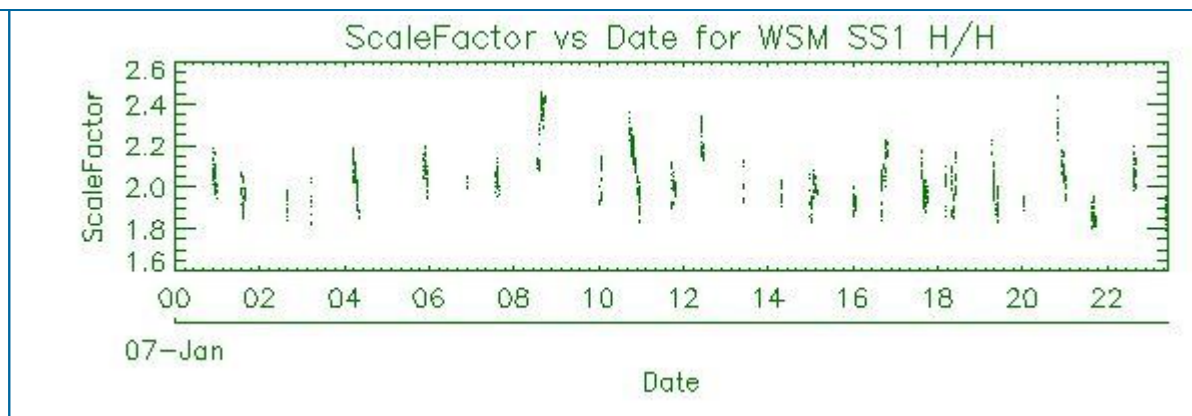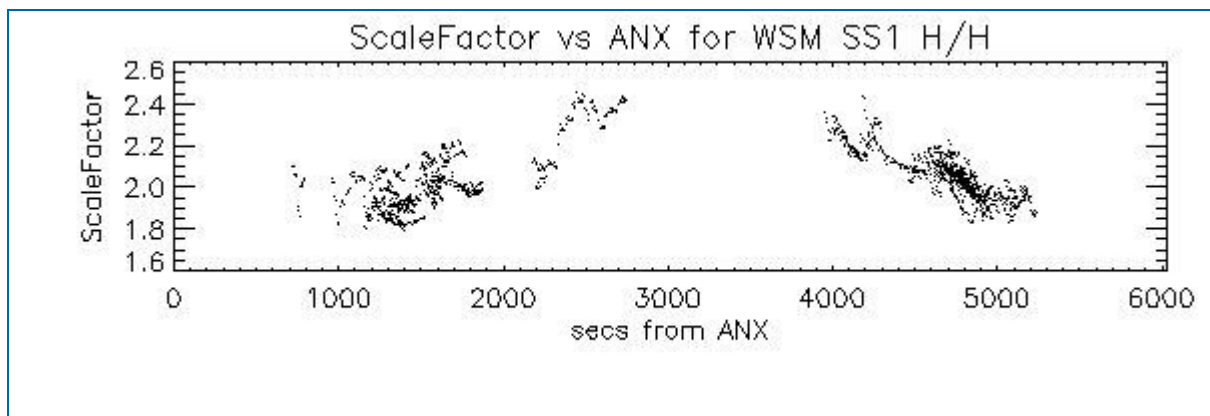

6.2 - Analysis for WSM SS1 V/V

6.2.1 - ScaleFactor

[[BACK TO MENU](#)]


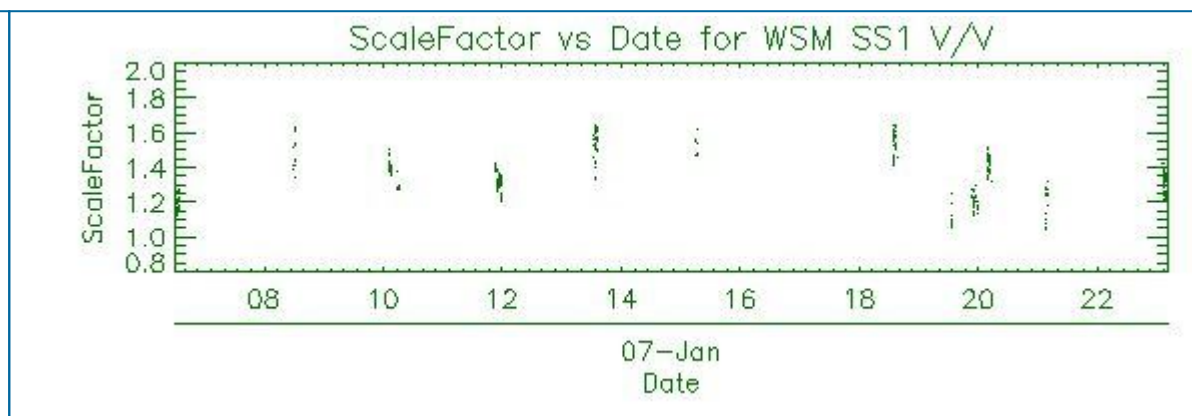
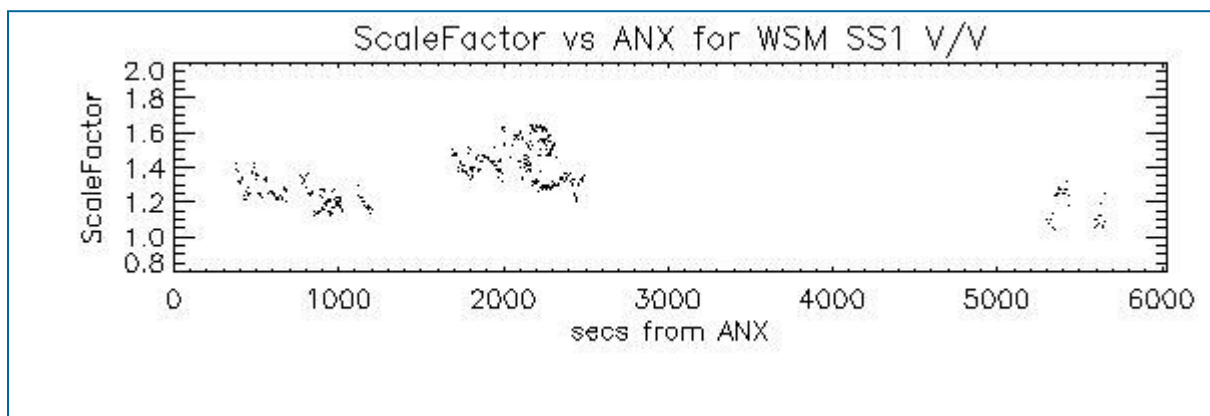


7 - RAW DATA ANALYSIS

7.1 - Analysis for WVS

[[BACK TO MENU](#)]


--	--	--

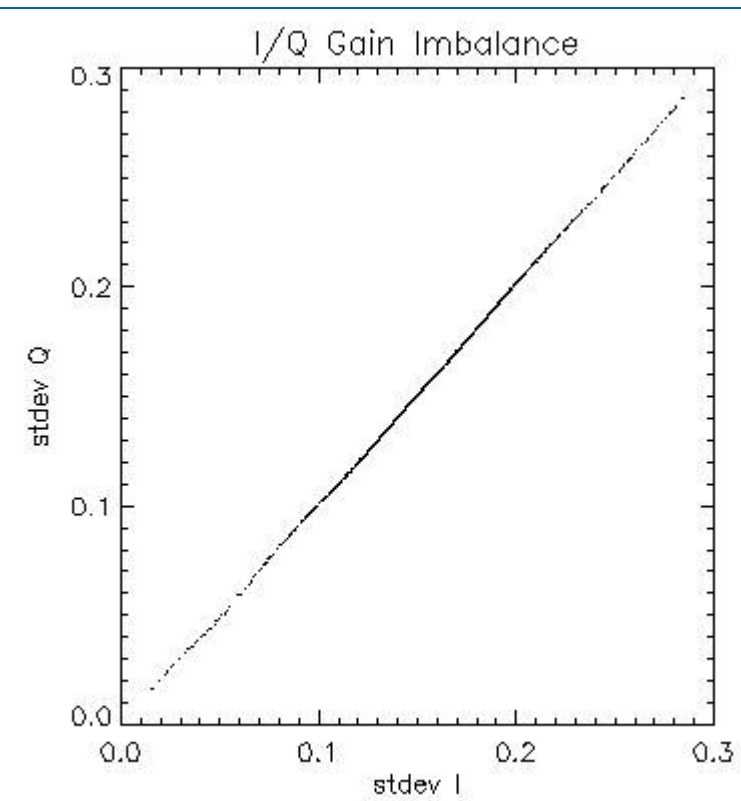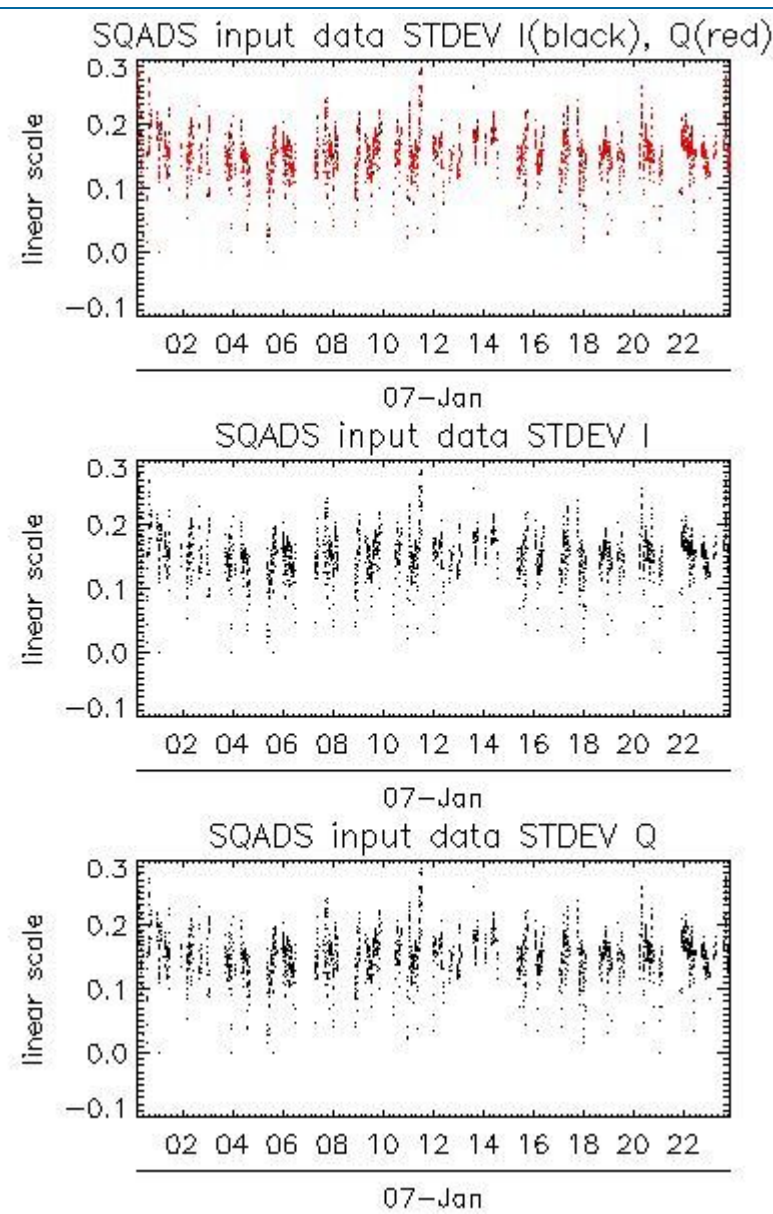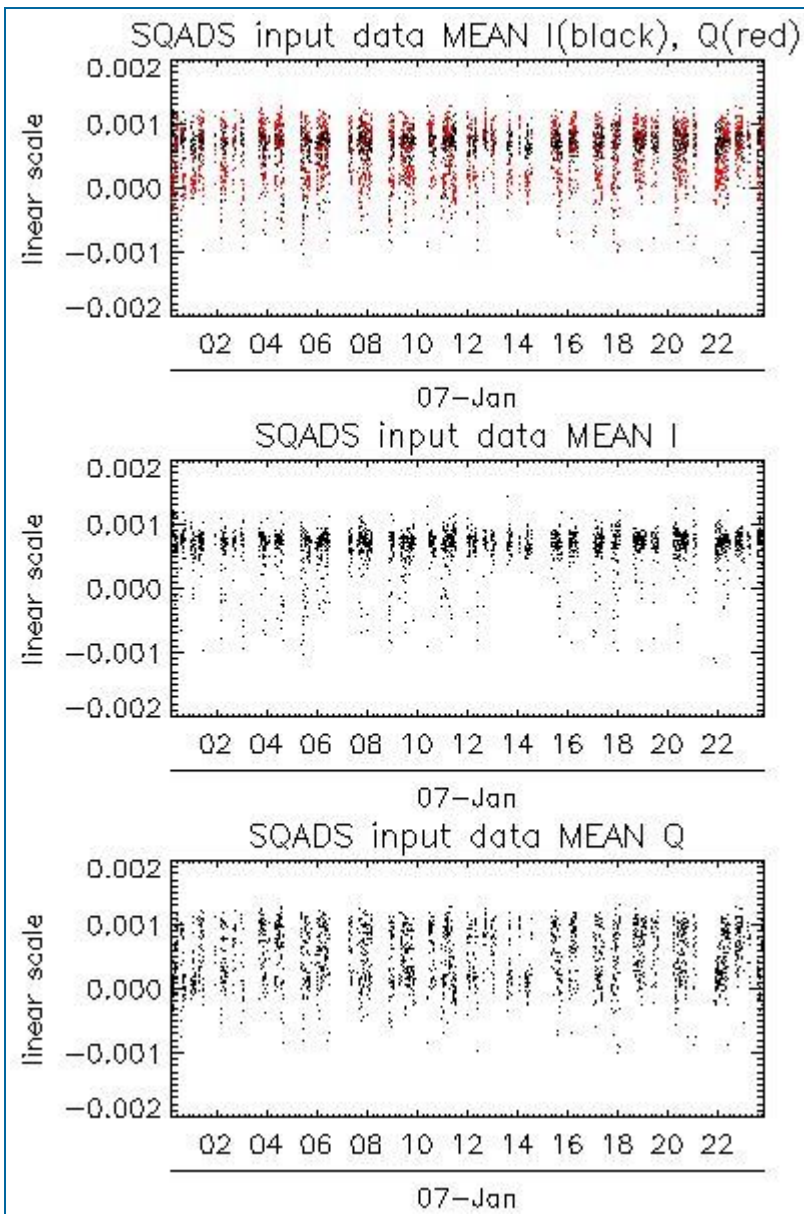


Channel	Statistics	DSS-B
MEAN I	mean	0.000645462
	stdev	1.01738e-07
MEAN Q	mean	0.000502778
	stdev	1.90277e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.153612
	stdev	0.00132959
STDEV Q	mean	0.154203
	stdev	0.00135661

7.2 - Analysis for IMM

[[BACK TO MENU](#)]



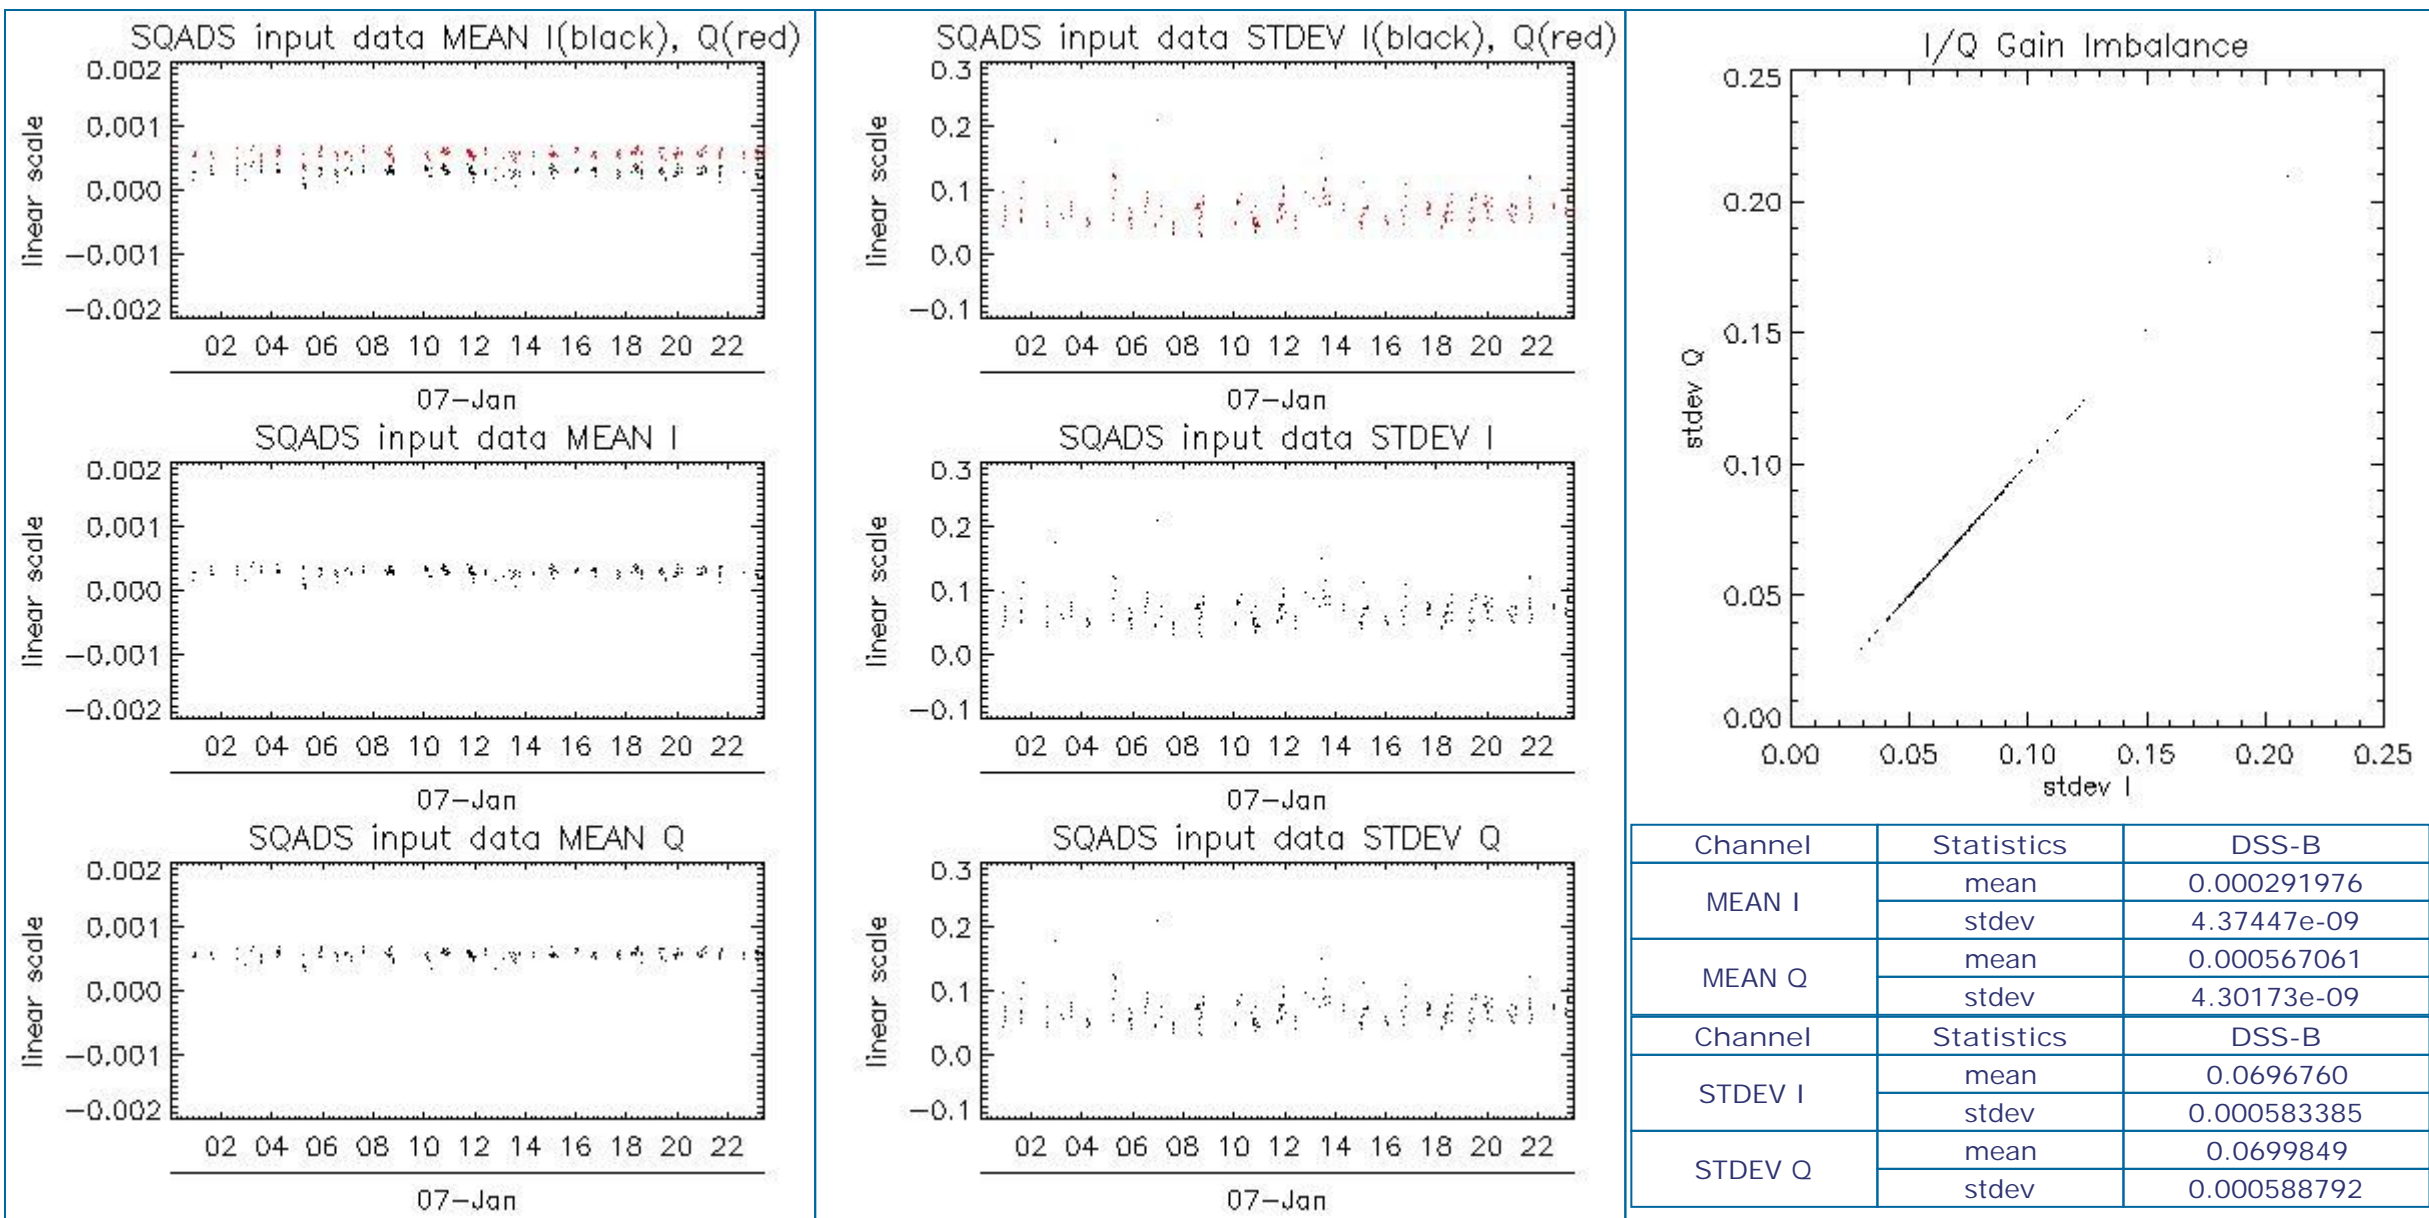


8 - TELEMETRY ANALYSIS

Processing Center	Product	Gaps	Missing lines
PDE	ASA_WSM_1PNPDE20110107_151519_00000923098_00169_46304_0344.N1	0	2

8.1 - Number of Missing lines


[[BACK TO MENU](#)]



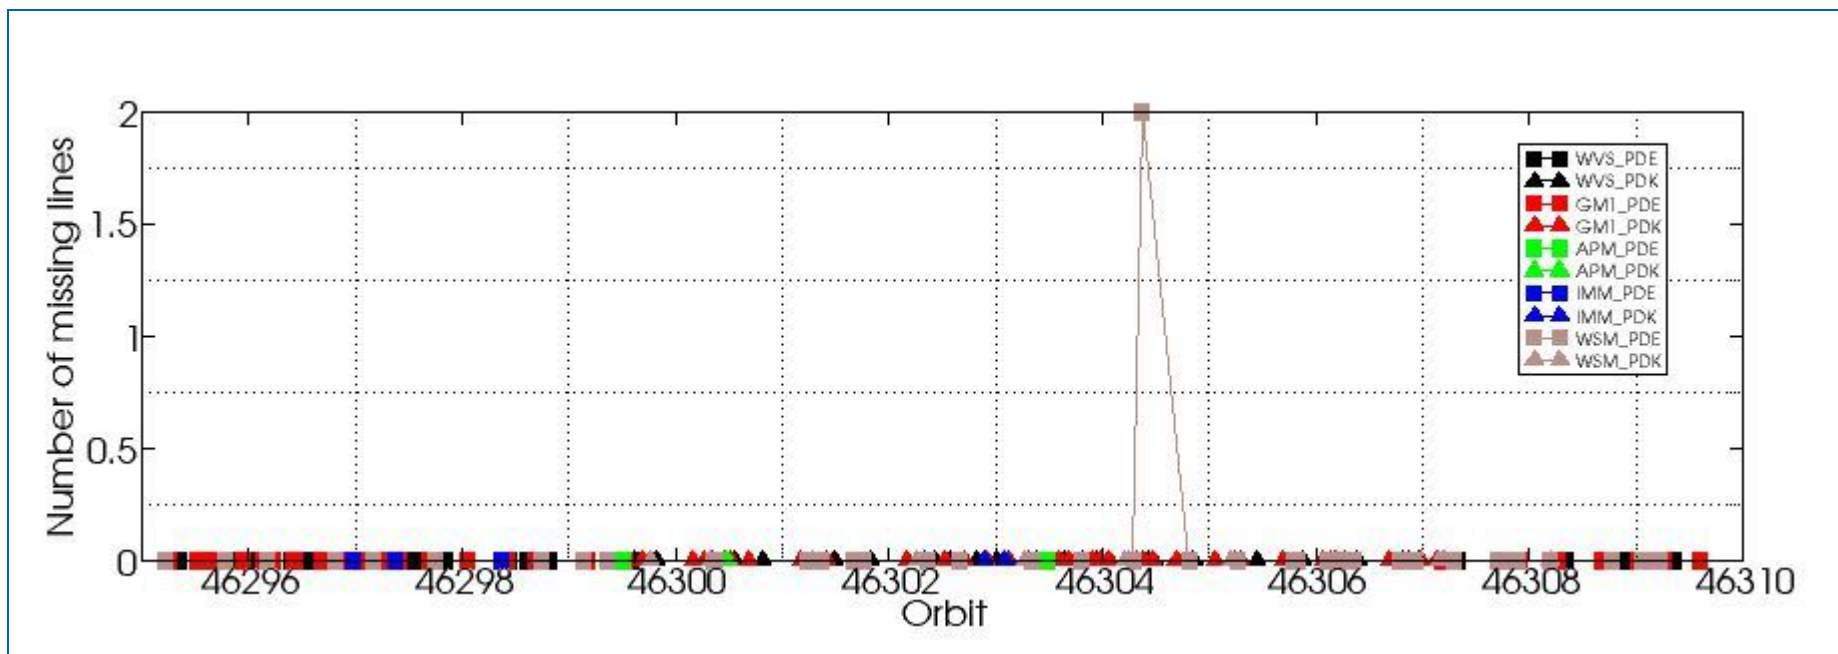

8.2 - Number of Gaps

[[BACK TO MENU](#)]

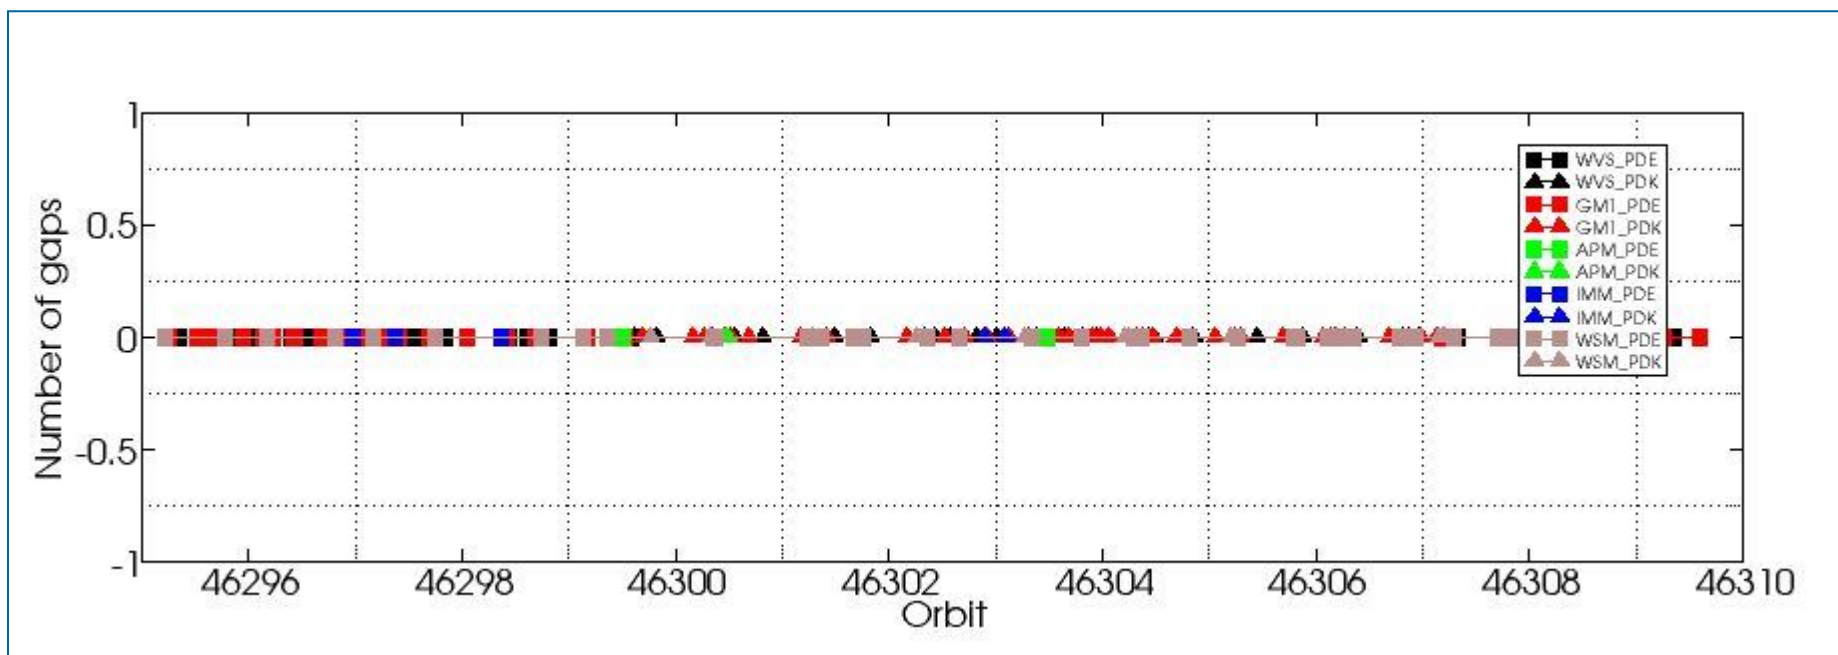

ASAR DAILY REPORT for 110107
#####

MODE: DAILY
ANALYSIS: ALL
DATE: 2011-01-07 00:00:00

Analysis will be performed from 2011-01-07 00:00:00 to 2011-01-07 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_110107/

DATA SUMMARY

Summary will be performed from 2011-01-07 00:00:00 to 2011-01-07 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_110107/DATA_SUMMARY

Creating directory ./RESULTS/DAILY/_110107/DATA_SUMMARY...
Writing file ./RESULTS/DAILY/_110107/DATA_SUMMARY/Data_summary.html...

Getting WVS products list from 2011-01-07 00:00:00 to 2011-01-07 23:59:59...
Writing file ./RESULTS/DAILY/_110107/DATA_SUMMARY/List_WVS_products_used.xls...
Writing file ./RESULTS/DAILY/_110107/DATA_SUMMARY/List_WVS_products_used.txt...

Getting GM1 products list from 2011-01-07 00:00:00 to 2011-01-07 23:59:59...
Writing file ./RESULTS/DAILY/_110107/DATA_SUMMARY/List_GM1_products_used.xls...
Writing file ./RESULTS/DAILY/_110107/DATA_SUMMARY/List_GM1_products_used.txt...

Getting APM products list from 2011-01-07 00:00:00 to 2011-01-07 23:59:59...
Writing file ./RESULTS/DAILY/_110107/DATA_SUMMARY/List_APM_products_used.xls...
Writing file ./RESULTS/DAILY/_110107/DATA_SUMMARY/List_APM_products_used.txt...

Getting IMM products list from 2011-01-07 00:00:00 to 2011-01-07 23:59:59...
Writing file ./RESULTS/DAILY/_110107/DATA_SUMMARY/List_IMM_products_used.xls...
Writing file ./RESULTS/DAILY/_110107/DATA_SUMMARY/List_IMM_products_used.txt...

Getting WSM products list from 2011-01-07 00:00:00 to 2011-01-07 23:59:59...
Writing file ./RESULTS/DAILY/_110107/DATA_SUMMARY/List_WSM_products_used.xls...
Writing file ./RESULTS/DAILY/_110107/DATA_SUMMARY/List_WSM_products_used.txt...

Getting MS products list from 2011-01-07 00:00:00 to 2011-01-07 23:59:59...
Writing file ./RESULTS/DAILY/_110107/DATA_SUMMARY/List_MS_products_used.xls...
Writing file ./RESULTS/DAILY/_110107/DATA_SUMMARY/List_MS_products_used.txt...

DATA SUMMARY completed
#####

AUXILIARY FILES ANALYSIS

Analysis will be performed from 2011-01-07 00:00:00 to 2011-01-07 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_110107/AUXILIARY

Creating directory ./RESULTS/DAILY/_110107/AUXILIARY...

Looking for the IECF operational ADFs list...



ADF filter 20110107*current_3_IECF_ADFs.txt
 Found list 20110107_030000_current_3_IECF_ADFs.txt...
 Extracting ADFs...

ASA_CON_AXVIEC20101222_141422_20100317_120410_20141231_000000
 ASA_INS_AXVIEC20101222_143805_20101022_000000_20141231_235959
 ASA_XCH_AXVIEC20101222_143057_20020301_000000_20141231_000000
 ASA_XCA_AXVIEC20101111_113830_20100601_000000_20141231_000000

Writing file ./RESULTS/DAILY/_110107/AUXILIARY/ASAR_ADFs_IECF_List3.html...
 Writing file ./RESULTS/DAILY/_110107/AUXILIARY/Auxiliary_files_summary.html...

Analysing WVS products...

Writing file ./RESULTS/DAILY/_110107/AUXILIARY/Check_ADFs_WVS.xls...
 Writing file ./RESULTS/DAILY/_110107/AUXILIARY/Check_ADFs_WVS.txt...

ASA_WVS_1PNPDE20110107_001143_000008993098_00160_46295_0182.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_003551_000005103098_00160_46295_0184.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_005917_000003593098_00160_46295_0185.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_010432_000003003098_00160_46295_0198.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_011622_000008243098_00160_46295_0209.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_015555_000000743098_00161_46296_0208.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_020927_000009153098_00161_46296_0207.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_023957_000003003098_00161_46296_0203.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_030003_000003143098_00162_46297_0220.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_034244_000007793098_00162_46297_0221.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_035514_000002553098_00162_46297_0234.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_040327_000000903098_00162_46297_0235.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_042000_000012293098_00162_46297_0237.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_052145_000010043098_00163_46298_0239.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_053814_000004053098_00163_46298_0254.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_055840_000018443098_00163_46298_0268.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_071636_000001803098_00164_46299_0267.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_201246_0000020693098_00172_46307_0356.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_210124_000000593098_00172_46307_0357.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_210124_000000593098_00172_46307_0360.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_210139_000003153098_00172_46307_0374.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_215230_000020993098_00173_46308_0377.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_215230_000020993098_00173_46308_0380.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_224101_000005553098_00173_46308_0376.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_224101_000005553098_00173_46308_0379.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_224931_000006593098_00173_46308_0395.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_231240_000002103098_00174_46309_0396.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20110107_233509_000008843098_00174_46309_0399.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_071921_000003603098_00164_46299_5199.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_073854_0000020393098_00164_46299_5265.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_085250_000007653098_00165_46300_5257.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_091917_000020993098_00165_46300_5260.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_102652_000009593098_00166_46301_5277.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_105922_000020693098_00166_46301_5282.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_115952_000005393098_00167_46302_5308.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_121506_000005253098_00167_46302_5310.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_123945_000004203098_00167_46302_5314.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_125743_000005173098_00167_46302_5315.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_133647_000005243098_00168_46303_5351.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_140317_000001803098_00168_46303_5353.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_142015_000004653098_00168_46303_5354.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_143250_000001193098_00168_46303_5358.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_152148_000001193098_00169_46304_5390.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_152613_000011243098_00169_46304_5393.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_160345_000011543098_00169_46304_5411.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_170342_000012893098_00170_46305_5432.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_174548_000011543098_00170_46305_5435.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_183754_000017393098_00171_46306_5458.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

ASA_WVS_1PNPDK20110107_192048_000000903098_00171_46306_5460.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_192628_000002703098_00171_46306_5461.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20110107_193424_000001493098_00171_46306_5463.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing GM1 products...

Writing file ./RESULTS/DAILY/_110107/AUXILIARY/Check_ADFs_GM1.xls...

Writing file ./RESULTS/DAILY/_110107/AUXILIARY/Check_ADFs_GM1.txt...

ASA_GM1_1PNPDE20110107_000105_000006283098_00160_46295_0180.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_002722_000001083098_00160_46295_0179.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_003008_000003443098_00160_46295_0183.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_004505_000005193098_00160_46295_0188.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_011018_000003623098_00160_46295_0215.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_013053_000001693098_00161_46296_0214.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_013942_000009733098_00161_46296_0213.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_015747_000001503098_00161_46296_0212.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_020055_000005133098_00161_46296_0211.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_022521_000007193098_00161_46296_0210.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_024543_000000963098_00161_46296_0206.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_024727_000004103098_00161_46296_0205.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_025507_000002953098_00161_46296_0204.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_030558_000004043098_00162_46297_0202.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_031419_000001873098_00162_46297_0201.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_031829_0000009063098_00162_46297_0217.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_033749_000002953098_00162_46297_0222.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_040536_000003263098_00162_46297_0236.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_044108_000019213098_00163_46298_0238.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_052000_000000963098_00163_46298_0240.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_054551_000003563098_00163_46298_0255.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_063440_000011483098_00164_46299_0259.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_065529_000001993098_00164_46299_0258.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_070009_000004533098_00164_46299_0256.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_071002_000003923098_00164_46299_0266.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_195627_000000663098_00172_46307_0354.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_200329_000003203098_00172_46307_0355.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_205104_000002653098_00172_46307_0358.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_205104_000002653098_00172_46307_0361.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_211004_000011783098_00172_46307_0373.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_214510_000004343098_00173_46308_0381.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_222807_000005193098_00173_46308_0385.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_230109_000002773098_00174_46309_0394.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_232028_000000903098_00174_46309_0393.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_232613_000005313098_00174_46309_0397.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20110107_235916_000000783098_00174_46309_0401.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_072605_000004833098_00164_46299_5200.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_081342_000003733098_00165_46300_5205.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_082447_000003023098_00165_46300_5255.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_083124_000001383098_00165_46300_5223.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_084348_000001203098_00165_46300_5224.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_084800_000002893098_00165_46300_5225.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_090617_000007793098_00165_46300_5229.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_095458_000003983098_00166_46301_5231.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_101824_000005073098_00166_46301_5280.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_113431_000005193098_00167_46302_5283.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_120939_000003263098_00167_46302_5309.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_122846_000006283098_00167_46302_5311.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_124847_000005373098_00167_46302_5312.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_130933_000008943098_00168_46303_5316.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_132807_000002173098_00168_46303_5349.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_135752_000003203098_00168_46303_5352.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_140659_000006283098_00168_46303_5356.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_142847_000002413098_00168_46303_5355.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_143533_000002173098_00168_46303_5357.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_144446_000008523098_00169_46304_5359.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

```
ASA_GM1_1PNPDK20110107_150958_000003203098_00169_46304_5389.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_151652_000002953098_00169_46304_5391.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_152436_000000903098_00169_46304_5392.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_154713_000007613098_00169_46304_5394.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_162347_000009243098_00170_46305_5395.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_162347_000009243098_00170_46305_5410.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_164253_000001023098_00170_46305_5429.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_164841_000009003098_00170_46305_5430.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_172728_000005673098_00170_46305_5434.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_180544_000003083098_00171_46306_5433.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_181232_000003563098_00171_46306_5436.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_181721_000000723098_00171_46306_5456.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_182638_000004223098_00171_46306_5457.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_190742_000005793098_00171_46306_5459.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_193733_000005553098_00171_46306_5462.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20110107_195124_000001443098_00172_46307_5464.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

Analysing APM products...

Writing file ./RESULTS/DAILY/_110107/AUXILIARY/Check_ADFs_APM.xls...

Writing file ./RESULTS/DAILY/_110107/AUXILIARY/Check_ADFs_APM.txt...

```
ASA_APM_1PNPDE20110107_065850_000000593098_00164_46299_0252.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20110107_070742_000001233098_00164_46299_0253.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20110107_134613_000000423098_00168_46303_0341.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDK20110107_084549_000001133098_00165_46300_5284.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

Analysing IMM products...

Writing file ./RESULTS/DAILY/_110107/AUXILIARY/Check_ADFs_IMM.xls...

Writing file ./RESULTS/DAILY/_110107/AUXILIARY/Check_ADFs_IMM.txt...

```
ASA_IMM_1PNPDE20110107_025419_000000383098_00161_46296_0200.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20110107_033335_000002433098_00162_46297_0196.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20110107_051308_000004003098_00163_46298_0233.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20110107_115014_000001223098_00167_46302_5294.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20110107_124759_000000383098_00167_46302_5307.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20110107_130704_000000623098_00168_46303_5313.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

Analysing WSM products...

Writing file ./RESULTS/DAILY/_110107/AUXILIARY/Check_ADFs_WSM.xls...

Writing file ./RESULTS/DAILY/_110107/AUXILIARY/Check_ADFs_WSM.txt...

```
ASA_WSM_1PNPDE20110107_005345_000003303098_00160_46295_0177.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_013348_000003493098_00161_46296_0197.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_023724_000001533098_00161_46296_0199.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_031243_000000923098_00162_46297_0219.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_041107_000005323098_00162_46297_0232.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_055151_000003923098_00163_46298_0257.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_063005_000002693098_00164_46299_0272.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_065353_000000923098_00164_46299_0251.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_083348_000005933098_00165_46300_0294.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_100141_000002143098_00166_46301_0307.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_101450_000000923098_00166_46301_0308.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_104340_000005753098_00166_46301_0318.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_105423_000002693098_00166_46301_0326.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_115322_000003923098_00167_46302_0327.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_122439_000002453098_00167_46302_0328.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

ASA_WSM_1PNPDE20110107_133217_000002693098_00168_46303_0340.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_141744_000001533098_00168_46303_0342.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_150715_000001593098_00169_46304_0343.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_151519_000000923098_00169_46304_0344.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_155955_000002323098_00169_46304_0339.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_164442_000002323098_00170_46305_0347.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_173701_000002513098_00170_46305_0345.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_174141_000002513098_00170_46305_0346.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_181054_000000923098_00171_46306_0348.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_182404_000001533098_00171_46306_0349.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_183345_000002513098_00171_46306_0352.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_191724_000001903098_00171_46306_0350.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_192257_000002143098_00171_46306_0351.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_193204_000000923098_00171_46306_0353.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_200850_000002393098_00172_46307_0370.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_204852_000001283098_00172_46307_0368.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_205530_00000353098_00172_46307_0367.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_210730_000001533098_00172_46307_0369.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_213835_000003923098_00173_46308_0375.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_213835_000003923098_00173_46308_0378.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_223650_000002513098_00173_46308_0372.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_230552_000003303098_00174_46309_0390.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20110107_232206_000002453098_00174_46309_0391.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20110107_073410_000002693098_00164_46299_5305.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20110107_082952_000000923098_00165_46300_5253.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20110107_100551_000001533098_00166_46301_5259.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20110107_114312_000003733098_00167_46302_5293.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20110107_132431_000001163098_00168_46303_5317.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20110107_145902_000002083098_00169_46304_5363.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20110107_150340_000001353098_00169_46304_5362.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20110107_163917_000002083098_00170_46305_5405.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20110107_181843_000002693098_00171_46306_5444.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20110107_195352_000001533098_00172_46307_5466.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20110107_195743_000001043098_00172_46307_5470.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20110107_200026_000001773098_00172_46307_5473.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20110107_213846_000002513098_00173_46308_5479.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

AUXILIARY FILES ANALYSIS completed

#####

MODULE STEPPING ANALYSIS

#####

Analysis will be performed from 2011-01-07 00:00:00 to 2011-01-07 23:59:59

Results will be exported to the directory: ./RESULTS/DAILY/_110107/MODULE_STEPPING

Creating directory ./RESULTS/DAILY/_110107/MODULE_STEPPING...

Creating directory ./RESULTS/DAILY/_110107/MODULE_STEPPING/FIRST_REFERENCE...

Creating directory ./RESULTS/DAILY/_110107/MODULE_STEPPING/SECOND_REFERENCE...

Creating directory ./RESULTS/DAILY/_110107/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Deleting old files...

Creating images comparing with second reference...

Exporting results to the directory ../../RESULTS/DAILY/_110107/MODULE_STEPPING/SECOND_REFERENCE...

Polarization: H

Reference product: ASA_MS_0PNPDK20010209_135042_0000009A024_00180_11700_0052.N1

Test product: ASA_MS_0PNPDK20110107_154540_000000163098_00169_46304_0384.N1

H

H

../../RESULTS/DAILY/_110107/MODULE_STEPPING/SECOND_REFERENCE/TGH_20110107_154540-20010209_135042.png

../../RESULTS/DAILY/_110107/MODULE_STEPPING/SECOND_REFERENCE/TPH_20110107_154540-20010209_135042.png

.././RESULTS/DAILY/_110107/MODULE_STEPPING/SECOND_REFERENCE/RGH_20110107_154540-20010209_135042.png
.././RESULTS/DAILY/_110107/MODULE_STEPPING/SECOND_REFERENCE/RPH_20110107_154540-20010209_135042.png

Polarization: V
Reference product: ASA_MS__0PNPDK20010209_140823_0000009A024_00180_11700_0054.N1
Test product: ASA_MS__0PNPDK20110107_172554_000000163098_00170_46305_0385.N1

V
V
.././RESULTS/DAILY/_110107/MODULE_STEPPING/SECOND_REFERENCE/TGV_20110107_172554-20010209_140823.png
.././RESULTS/DAILY/_110107/MODULE_STEPPING/SECOND_REFERENCE/TPV_20110107_172554-20010209_140823.png
.././RESULTS/DAILY/_110107/MODULE_STEPPING/SECOND_REFERENCE/RGV_20110107_172554-20010209_140823.png
.././RESULTS/DAILY/_110107/MODULE_STEPPING/SECOND_REFERENCE/RPV_20110107_172554-20010209_140823.png

Creating images comparing with previous product reference...

Exporting results to the directory .././RESULTS/DAILY/_110107/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Polarization: H
Reference product: ASA_MS__0PNPDK20110106_162224_000000163098_00155_46290_0382.N1
Test product: ASA_MS__0PNPDK20110107_154540_000000163098_00169_46304_0384.N1

H
H
.././RESULTS/DAILY/_110107/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGH_20110107_154540-20110106_162224.png
.././RESULTS/DAILY/_110107/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPH_20110107_154540-20110106_162224.png
.././RESULTS/DAILY/_110107/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGH_20110107_154540-20110106_162224.png
.././RESULTS/DAILY/_110107/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPH_20110107_154540-20110106_162224.png

Polarization: V
Reference product: ASA_MS__0PNPDK20110106_180238_000000163098_00156_46291_0383.N1
Test product: ASA_MS__0PNPDK20110107_172554_000000163098_00170_46305_0385.N1

V
V
.././RESULTS/DAILY/_110107/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGV_20110107_172554-20110106_180238.png
.././RESULTS/DAILY/_110107/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPV_20110107_172554-20110106_180238.png
.././RESULTS/DAILY/_110107/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGV_20110107_172554-20110106_180238.png
.././RESULTS/DAILY/_110107/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPV_20110107_172554-20110106_180238.png

MODULE_STEPPING ANALYSIS completed
#####

CALIBRATION PULSES ANALYSIS

Creating directory ./RESULTS/DAILY/_110107/CALIBRATION_PULSES...

ALL ROWS Analysis will be performed from 2011-01-07 00:00:00 to 2011-01-07 23:59:59

Analysing products WVS IS2 V/V
Writing image .././RESULTS/DAILY/_110107//CALIBRATION_PULSES/Calibration_pulses_all_rows_WVS_IS2_VV.png...
Analysing products GM1 SS3 H/H
Writing image .././RESULTS/DAILY/_110107//CALIBRATION_PULSES/Calibration_pulses_all_rows_GM1_SS3_HH.png...

TEMPORAL EVOLUTION Analysis will be performed from 2011-01-07 00:00:00 to 2011-01-07 23:59:59

Analysing products WVS IS2 V/V
Getting calibration pulses data for WVS IS2 V/V from 2011-01-07 00:00:00 to 2011-01-07 23:59:59. Rows: 1/5/9/13/17/21/25/29
Writing file ./RESULTS/DAILY/_110107/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2011-01-07_1.dat...
Writing .././RESULTS/DAILY/_110107//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_1.png...

Writing ../../RESULTS/DAILY/_110107//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2011-01-07 00:00:00 to 2011-01-07 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/_110107/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2011-01-07_2.dat...

Writing ../../RESULTS/DAILY/_110107//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_2.png...

Writing ../../RESULTS/DAILY/_110107//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2011-01-07 00:00:00 to 2011-01-07 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/_110107/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2011-01-07_3.dat...

Writing ../../RESULTS/DAILY/_110107//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_3.png...

Writing ../../RESULTS/DAILY/_110107//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2011-01-07 00:00:00 to 2011-01-07 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/_110107/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2011-01-07_4.dat...

Writing ../../RESULTS/DAILY/_110107//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_4.png...

Writing ../../RESULTS/DAILY/_110107//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_4.png...

Analysing products GM1 SS3 H/H

Getting calibration pulses data for GM1 SS3 H/H from 2011-01-07 00:00:00 to 2011-01-07 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/_110107/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2011-01-07_1.dat...

Writing ../../RESULTS/DAILY/_110107//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_1.png...

Writing ../../RESULTS/DAILY/_110107//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_1.png...

Getting calibration pulses data for GM1 SS3 H/H from 2011-01-07 00:00:00 to 2011-01-07 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/_110107/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2011-01-07_2.dat...

Writing ../../RESULTS/DAILY/_110107//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_2.png...

Writing ../../RESULTS/DAILY/_110107//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2011-01-07 00:00:00 to 2011-01-07 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/_110107/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2011-01-07_3.dat...

Writing ../../RESULTS/DAILY/_110107//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_3.png...

Writing ../../RESULTS/DAILY/_110107//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2011-01-07 00:00:00 to 2011-01-07 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/_110107/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2011-01-07_4.dat...

Writing ../../RESULTS/DAILY/_110107//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_4.png...

Writing ../../RESULTS/DAILY/_110107//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_4.png...

CALIBRATION PULSES ANALYSIS completed

#####

DOPPLER ANALYSIS

#####

Creating directory ./RESULTS/DAILY/_110107/DOPPLER...

DOPPLER ANX Analysis will be performed from 2011-01-07 00:00:00 to 2011-01-07 23:59:59

Analysing products WVS IS2 V/V

Getting doppler data for WVS IS2 V/V from 2011-01-07 00:00:00 to 2011-01-07 23:59:59...

Writing file ./RESULTS/DAILY/_110107/DOPPLER/Doppler_data_WVS_IS2_VV_2011-01-07.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/_110107/DOPPLER/DOPPLER_ANX_WVS_IS2_VV.png...

Analysing products GM1 SS1 H/H
Getting doppler data for GM1 SS1 H/H from 2011-01-07 00:00:00 to 2011-01-07 23:59:59...
Writing file ./RESULTS/DAILY/_110107/DOPPLER/Doppler_data_GM1_SS1_HH_2011-01-07.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/_110107/DOPPLER/DOPPLER_ANX_GM1_SS1_HH.png...

DOPPLER JUMPS Analysis will be performed on WSM products from 2011-01-07 00:00:00 to 2011-01-07 23:59:59

Analysing by default products WSM
Getting doppler jumps data for WSM from 2011-01-07 00:00:00 to 2011-01-07 23:59:59...
Writing file ./RESULTS/DAILY/_110107/DOPPLER/Doppler_Jumps_data_WSM_2011-01-07.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/_110107/DOPPLER/DOPPLER_JUMPS_ANX_WSM.png...
Writing file ../../RESULTS/DAILY/_110107/DOPPLER/DOPPLER_JUMPS_Date_WSM.png...

DOPPLER MAP Analysis will be performed from 2011-01-07 00:00:00 to 2011-01-07 23:59:59

Analysing products WVS IS2 V/V
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -74.850501 Hz
Writing file ../../RESULTS/DAILY/_110107//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_desc.jpg...
Writing file ../../RESULTS/DAILY/_110107//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_desc.jpg...

Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -65.756838 Hz
Writing file ../../RESULTS/DAILY/_110107//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_asc.jpg...
Writing file ../../RESULTS/DAILY/_110107//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_asc.jpg...

Analysing products GM1 SS1 H/H
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -58.126009 Hz
Writing file ../../RESULTS/DAILY/_110107//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_desc.jpg...
Writing file ../../RESULTS/DAILY/_110107//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_desc.jpg...

Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -59.202740 Hz
Writing file ../../RESULTS/DAILY/_110107//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_asc.jpg...
Writing file ../../RESULTS/DAILY/_110107//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_asc.jpg...

DOPPLER ANALYSIS completed
#####

CHIRP ANALYSIS

#####

Creating directory ./RESULTS/DAILY/_110107/CHIRP...

CHIRP Analysis will be performed from 2011-01-07 00:00:00 to 2011-01-07 23:59:59

Analysing products WSM SS1 H/H

Getting ScaleFactor data for WSM SS1 H/H from 2011-01-07 00:00:00 to 2011-01-07 23:59:59...

Writing file ./RESULTS/DAILY/_110107/CHIRP/ScaleFactor_data_WSM_SS1_HH_2011-01-07.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/_110107/CHIRP/ScaleFactor_ANX_WSM_SS1_HH.png...

Writing file ../../RESULTS/DAILY/_110107/CHIRP/ScaleFactor_DATE_WSM_SS1_HH.png...

Analysing products WSM SS1 V/V

Getting ScaleFactor data for WSM SS1 V/V from 2011-01-07 00:00:00 to 2011-01-07 23:59:59...

Writing file ./RESULTS/DAILY/_110107/CHIRP/ScaleFactor_data_WSM_SS1_VV_2011-01-07.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/_110107/CHIRP/ScaleFactor_ANX_WSM_SS1_VV.png...

Writing file ../../RESULTS/DAILY/_110107/CHIRP/ScaleFactor_DATE_WSM_SS1_VV.png...

CHIRP ANALYSIS completed

#####

RAW DATA ANALYSIS

#####

Analysis will be performed from 2011-01-07 00:00:00 to 2011-01-07 23:59:59

Results will be exported to the directory: ./RESULTS/DAILY/_110107/RAW_DATA

Creating directory ./RESULTS/DAILY/_110107/RAW_DATA...

Getting raw data for WVS from 2011-01-07 00:00:00 to 2011-01-07 23:59:59...

Writing file ./RESULTS/DAILY/_110107/RAW_DATA/Raw_data_WVS_2011-01-07.dat...

Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/_110107/RAW_DATA/Raw_data_WVS_input_mean.png...

Creating image ../../RESULTS/DAILY/_110107/RAW_DATA/Raw_data_WVS_input_stdev.png...

Creating image ../../RESULTS/DAILY/_110107/RAW_DATA/Raw_data_WVS_gain_imbalance.png...

Getting raw data for IMM from 2011-01-07 00:00:00 to 2011-01-07 23:59:59...

Writing file ./RESULTS/DAILY/_110107/RAW_DATA/Raw_data_IMM_2011-01-07.dat...

Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/_110107/RAW_DATA/Raw_data_IMM_input_mean.png...

Creating image ../../RESULTS/DAILY/_110107/RAW_DATA/Raw_data_IMM_input_stdev.png...

Creating image ../../RESULTS/DAILY/_110107/RAW_DATA/Raw_data_IMM_gain_imbalance.png...

RAW DATA ANALYSIS completed

#####

TELEMETRY ANALYSIS



Analysis will be performed from 2011-01-07 00:00:00 to 2011-01-07 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_110107/TELEMETRY

Creating directory ./RESULTS/DAILY/_110107/TELEMETRY...

Looking for gaps and missing lines in WVS products...

Checking 28 products from PDE...
Checking 23 products from PDK...

Looking for gaps and missing lines in GM1 products...

Checking 36 products from PDE...
Checking 36 products from PDK...

Looking for gaps and missing lines in APM products...

Checking 3 products from PDE...
Checking 1 products from PDK...

Looking for gaps and missing lines in IMM products...

Checking 3 products from PDE...
Checking 3 products from PDK...

Looking for gaps and missing lines in WSM products...

Checking 39 products from PDE...
Found product..ASA_WSM_1PNPDE20110107_151519_00000923098_00169_46304_0344.N1 / 0 gaps / 2 missing lines
Checking 13 products from PDK...

Creating graph of missing lines and gaps...

Creating image: ./RESULTS/DAILY/_110107/TELEMETRY/TELEMETRY_Missing_lines.png...
Creating image: ./RESULTS/DAILY/_110107/TELEMETRY/TELEMETRY_Gaps.png...

TELEMETRY ANALYSIS completed
#####

HTML REPORT generation
#####

Building file ./RESULTS/DAILY/_110107/asarReport.html...
Building DATA SUMMARY section...
Building AUXILIARY FILES ANALYSIS section...
Building MODULE STEPPING ANALYSIS section...
Building CALIBRATION PULSES ANALYSIS section...
Building DOPPLER ANALYSIS section...
Building CHIRP ANALYSIS section...
Building RAW DATA ANALYSIS section...
Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed
#####



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20110107_065850_000000593098_00164_46299_0252.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20110107_070742_000001233098_00164_46299_0253.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20110107_134613_000000423098_00168_46303_0341.N1	OK	OK	OK	OK
ASA_APM_1PNPDK20110107_084549_000001133098_00165_46300_5284.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20110107_000105_000006283098_00160_46295_0180.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_002722_000001083098_00160_46295_0179.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_003008_000003443098_00160_46295_0183.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_004505_000005193098_00160_46295_0188.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_011018_000003623098_00160_46295_0215.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_013053_000001693098_00161_46296_0214.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_013942_000009733098_00161_46296_0213.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_015747_000001503098_00161_46296_0212.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_020055_000005133098_00161_46296_0211.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_022521_000007193098_00161_46296_0210.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_024543_000000963098_00161_46296_0206.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_024727_000004103098_00161_46296_0205.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_025507_000002953098_00161_46296_0204.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_030558_000004043098_00162_46297_0202.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_031419_000001873098_00162_46297_0201.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_031829_000009063098_00162_46297_0217.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_033749_000002953098_00162_46297_0222.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_040536_000003263098_00162_46297_0236.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_044108_000019213098_00163_46298_0238.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_052000_000000963098_00163_46298_0240.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_054551_000003563098_00163_46298_0255.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_063440_000011483098_00164_46299_0259.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_065529_000001993098_00164_46299_0258.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_070009_000004533098_00164_46299_0256.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_071002_000003923098_00164_46299_0266.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_195627_000000663098_00172_46307_0354.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_200329_000003203098_00172_46307_0355.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_205104_000002653098_00172_46307_0358.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_205104_000002653098_00172_46307_0361.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_211004_000011783098_00172_46307_0373.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_214510_000004343098_00173_46308_0381.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_222807_000005193098_00173_46308_0385.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_230109_000002773098_00174_46309_0394.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_232028_000000903098_00174_46309_0393.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_232613_000005313098_00174_46309_0397.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20110107_235916_000000783098_00174_46309_0401.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_072605_000004833098_00164_46299_5200.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_081342_000007373098_00165_46300_5205.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_082447_000003023098_00165_46300_5255.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_083124_000001383098_00165_46300_5223.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_084348_000001203098_00165_46300_5224.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_084800_000002893098_00165_46300_5225.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_090617_000007793098_00165_46300_5229.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_095458_000003983098_00166_46301_5231.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_101824_000005073098_00166_46301_5280.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_113431_000005193098_00167_46302_5283.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_120939_000003263098_00167_46302_5309.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_122846_000006283098_00167_46302_5311.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_124847_000005373098_00167_46302_5312.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_130933_000008943098_00168_46303_5316.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_132807_000002173098_00168_46303_5349.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_135752_000003203098_00168_46303_5352.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_140659_000006283098_00168_46303_5356.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_142847_000002413098_00168_46303_5355.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_143533_000002173098_00168_46303_5357.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_144446_000008523098_00169_46304_5359.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_150958_000003203098_00169_46304_5389.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_151652_000002953098_00169_46304_5391.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_152436_000000903098_00169_46304_5392.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_154713_000007613098_00169_46304_5394.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_162347_000009243098_00170_46305_5395.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_162347_000009243098_00170_46305_5410.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_164253_000001023098_00170_46305_5429.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_164841_000009003098_00170_46305_5430.N1					OK	OK	OK	OK

ASA_GM1_1PNPDK20110107_172728_000005673098_00170_46305_5434.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_180544_000003083098_00171_46306_5433.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_181232_000003563098_00171_46306_5436.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_181721_000000723098_00171_46306_5456.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_182638_000004223098_00171_46306_5457.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_190742_000005793098_00171_46306_5459.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_193733_000005553098_00171_46306_5462.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20110107_195124_000001443098_00172_46307_5464.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_IMM_1PNPDE20110107_025419_000000383098_00161_46296_0200.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20110107_033335_000002433098_00162_46297_0196.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20110107_051308_000004003098_00163_46298_0233.N1	OK	OK	OK	OK
ASA_IMM_1PNPDK20110107_115014_000001223098_00167_46302_5294.N1	OK	OK	OK	OK
ASA_IMM_1PNPDK20110107_124759_000000383098_00167_46302_5307.N1	OK	OK	OK	OK
ASA_IMM_1PNPDK20110107_130704_000000623098_00168_46303_5313.N1	OK	OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WSM_1PNPDE20110107_005345_000003303098_00160_46295_0177.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_013348_000003493098_00161_46296_0197.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_023724_000001533098_00161_46296_0199.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_031243_000000923098_00162_46297_0219.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_041107_000005323098_00162_46297_0232.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_055151_000003923098_00163_46298_0257.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_063005_000002693098_00164_46299_0272.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_065353_000000923098_00164_46299_0251.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_083348_000005933098_00165_46300_0294.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_100141_000002143098_00166_46301_0307.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_101450_000000923098_00166_46301_0308.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_104340_000005753098_00166_46301_0318.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_105423_000002693098_00166_46301_0326.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_115322_000003923098_00167_46302_0327.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_122439_000002453098_00167_46302_0328.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_133217_000002693098_00168_46303_0340.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_141744_000001533098_00168_46303_0342.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_150715_000001593098_00169_46304_0343.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_151519_000000923098_00169_46304_0344.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_155955_000002323098_00169_46304_0339.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_164442_000002323098_00170_46305_0347.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_173701_000002513098_00170_46305_0345.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_174141_000002513098_00170_46305_0346.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_181054_000000923098_00171_46306_0348.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_182404_000001533098_00171_46306_0349.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_183345_000002513098_00171_46306_0352.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_191724_000001903098_00171_46306_0350.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_192257_000002143098_00171_46306_0351.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_193204_000000923098_00171_46306_0353.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_200850_000002393098_00172_46307_0370.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_204852_000001283098_00172_46307_0368.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_205530_000003553098_00172_46307_0367.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_210730_000001533098_00172_46307_0369.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_213835_000003923098_00173_46308_0375.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_213835_000003923098_00173_46308_0378.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_223650_000002513098_00173_46308_0372.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_230552_000003303098_00174_46309_0390.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20110107_232206_000002453098_00174_46309_0391.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20110107_073410_000002693098_00164_46299_5305.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20110107_082952_000000923098_00165_46300_5253.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20110107_100551_000001533098_00166_46301_5259.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20110107_114312_000003733098_00167_46302_5293.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20110107_132431_000001163098_00168_46303_5317.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20110107_145902_000002083098_00169_46304_5363.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20110107_150340_000001353098_00169_46304_5362.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20110107_163917_000002083098_00170_46305_5405.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20110107_181843_000002693098_00171_46306_5444.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20110107_195352_000001533098_00172_46307_5466.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20110107_195743_000001043098_00172_46307_5470.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20110107_200026_000001773098_00172_46307_5473.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20110107_213846_000002513098_00173_46308_5479.N1					OK	OK	OK	OK





Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20110107_001143_000008993098_00160_46295_0182.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_003551_000005103098_00160_46295_0184.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_005917_000003593098_00160_46295_0185.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_010432_000003003098_00160_46295_0198.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_011622_000008243098_00160_46295_0209.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_015555_000000743098_00161_46296_0208.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_020927_000009153098_00161_46296_0207.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_023957_000003003098_00161_46296_0203.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_030003_000003143098_00162_46297_0220.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_034244_000007793098_00162_46297_0221.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_035514_000002553098_00162_46297_0234.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_040327_000000903098_00162_46297_0235.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_042000_000012293098_00162_46297_0237.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_052145_000010043098_00163_46298_0239.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_053814_000004053098_00163_46298_0254.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_055840_000018443098_00163_46298_0268.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_071636_000001803098_00164_46299_0267.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_201246_000020693098_00172_46307_0356.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_210124_000000593098_00172_46307_0357.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_210124_000000593098_00172_46307_0360.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_210139_000003153098_00172_46307_0374.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_215230_000020993098_00173_46308_0377.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_215230_000020993098_00173_46308_0380.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_224101_000005553098_00173_46308_0376.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_224101_000005553098_00173_46308_0379.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_224931_000006593098_00173_46308_0395.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_231240_000002103098_00174_46309_0396.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20110107_233509_000008843098_00174_46309_0399.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_071921_000003603098_00164_46299_5199.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_073854_000020393098_00164_46299_5265.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_085250_000007653098_00165_46300_5257.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_091917_000020993098_00165_46300_5260.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_102652_000009593098_00166_46301_5277.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_105922_000020693098_00166_46301_5282.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_115952_000005393098_00167_46302_5308.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_121506_000005253098_00167_46302_5310.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_123945_000004203098_00167_46302_5314.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_125743_000005173098_00167_46302_5315.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_133647_000005243098_00168_46303_5351.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_140317_000001803098_00168_46303_5353.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_142015_000004653098_00168_46303_5354.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_143250_000001193098_00168_46303_5358.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_152148_000001193098_00169_46304_5390.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_152613_000011243098_00169_46304_5393.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_160345_000011543098_00169_46304_5411.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_170342_000012893098_00170_46305_5432.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_174548_000011543098_00170_46305_5435.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_183754_000017393098_00171_46306_5458.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_192048_000000903098_00171_46306_5460.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_192628_000002703098_00171_46306_5461.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20110107_193424_000001493098_00171_46306_5463.N1					OK	OK	OK	OK


Calibration pulses for GM1 SS3 H/H

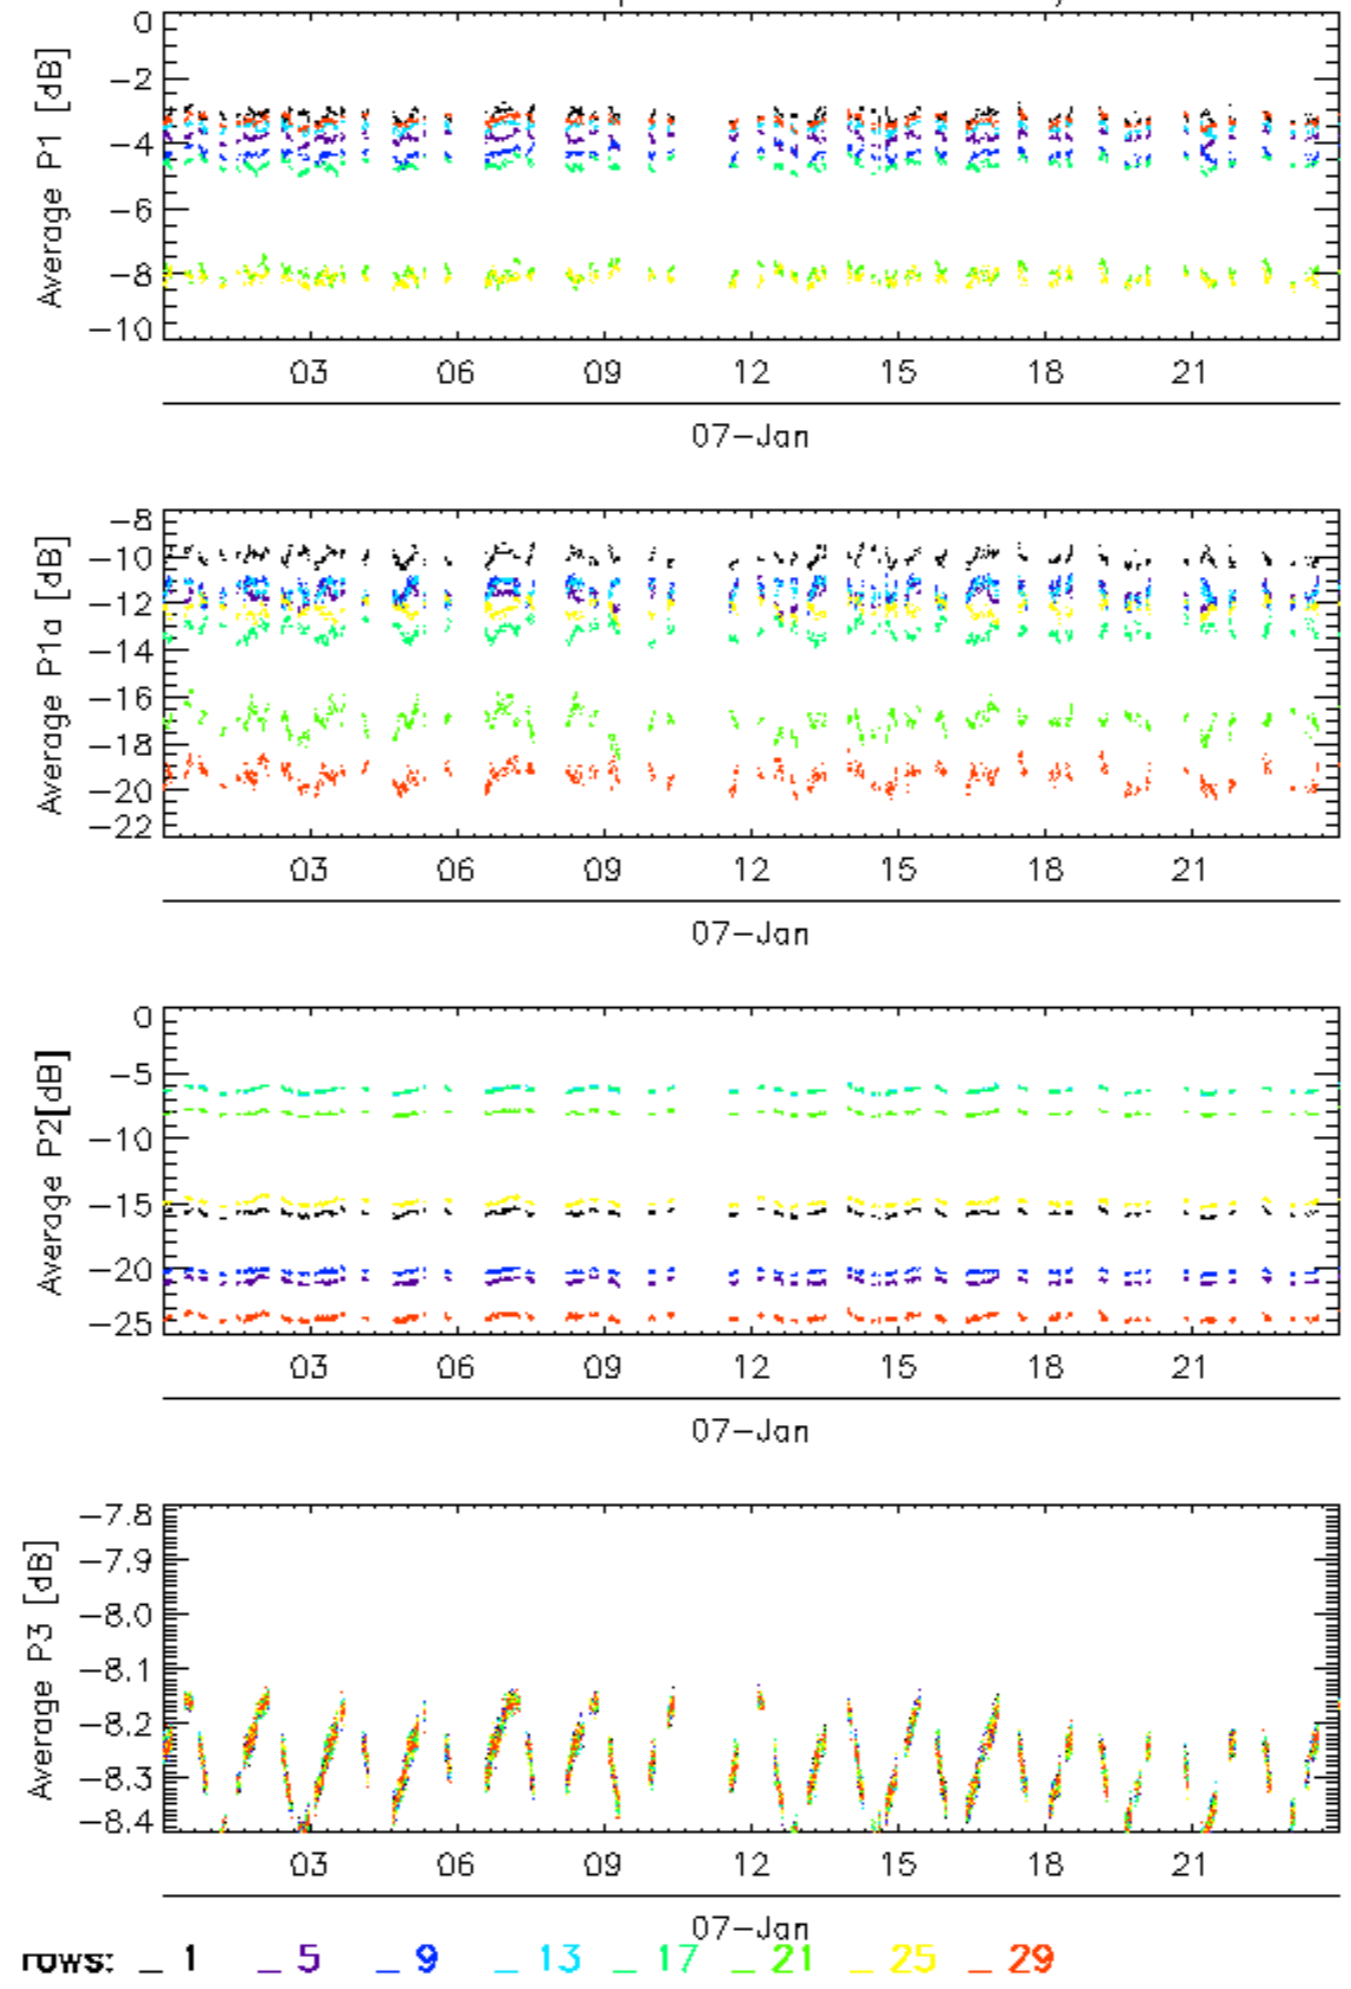


Calibration pulses for GM1 SS3 H/H

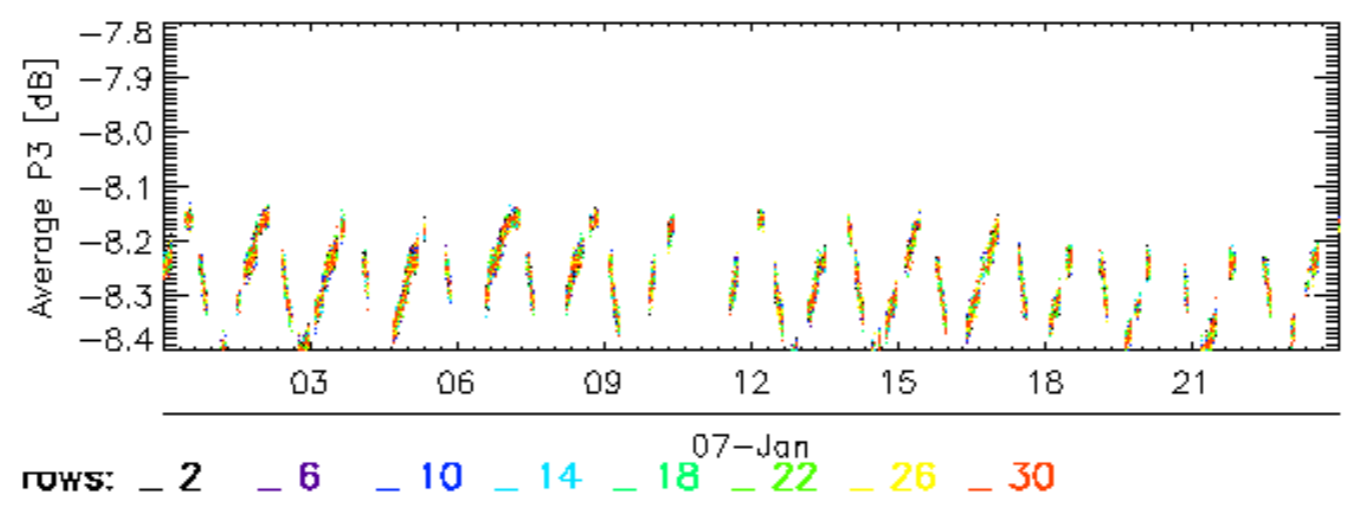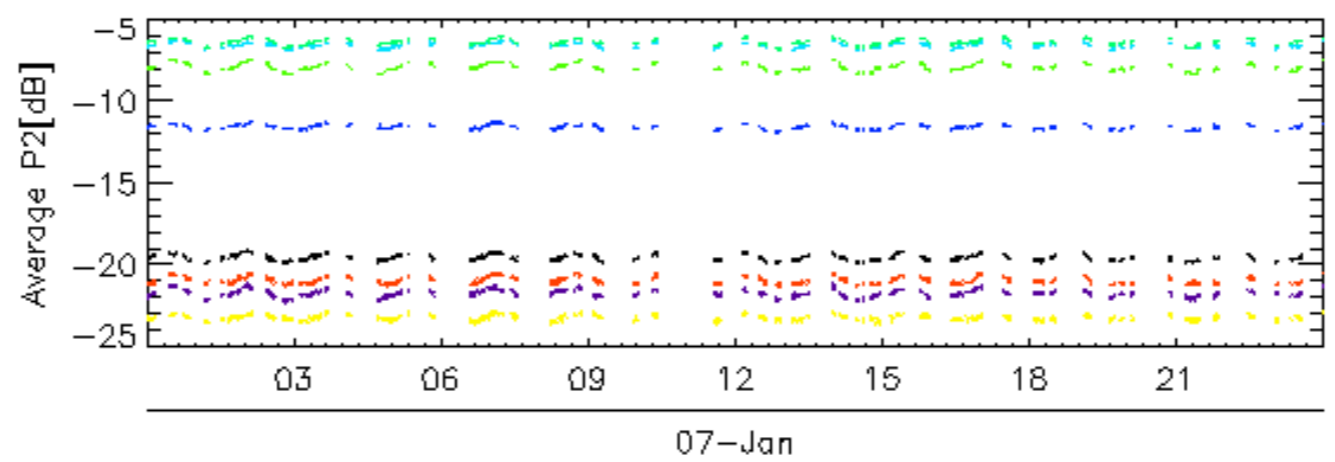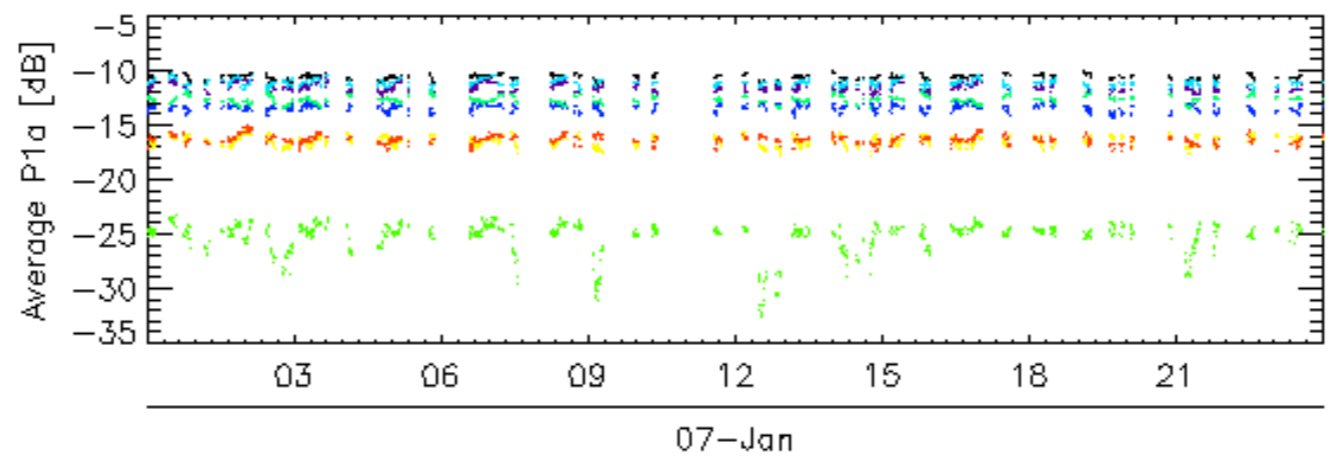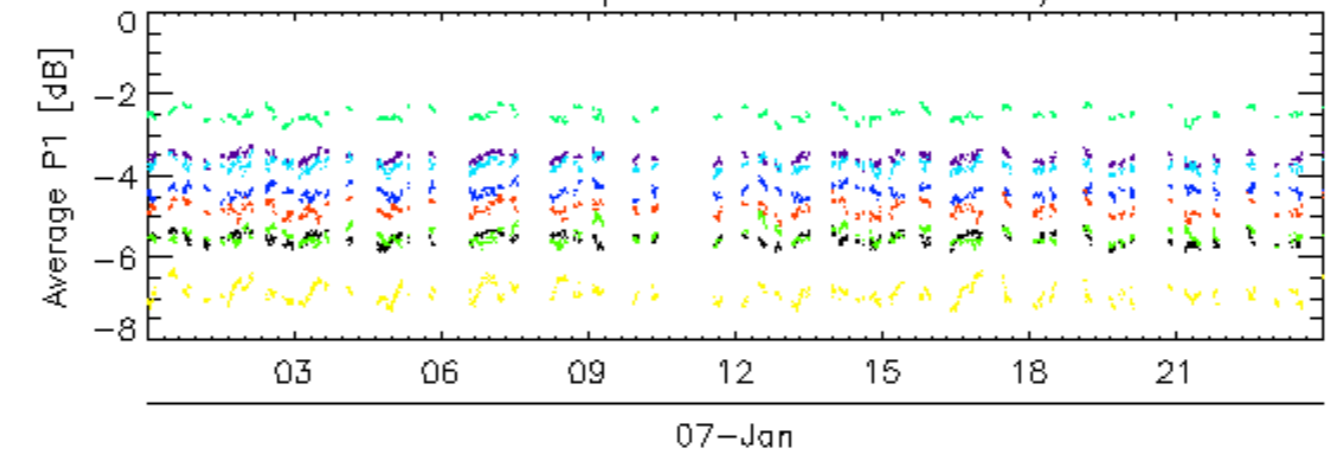


Calibration pulses for GM1 SS3 H/H

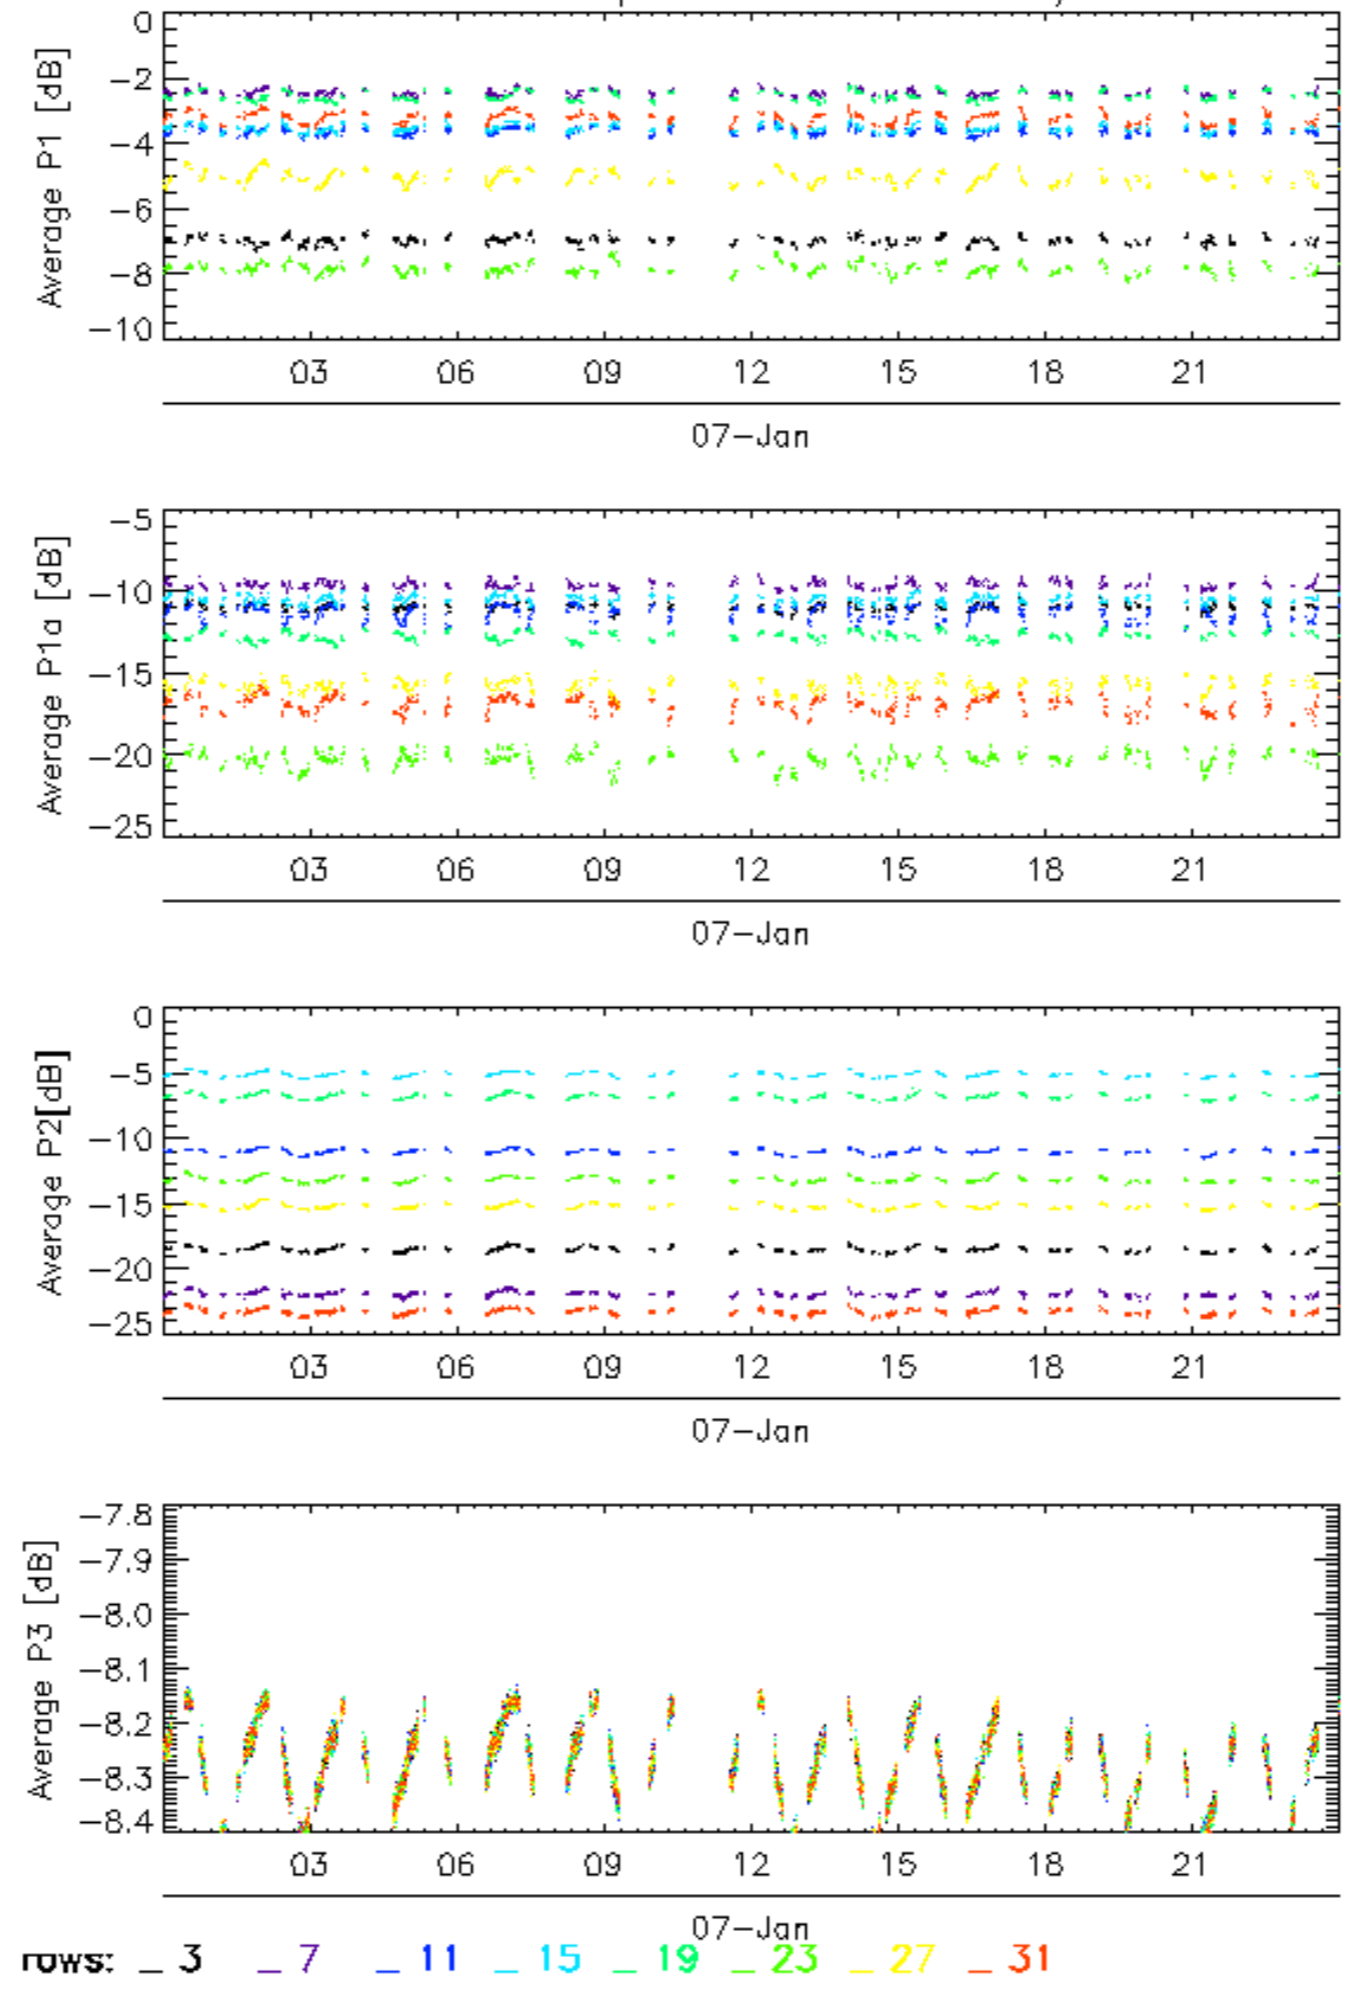


Calibration pulses for GM1 SS3 H/H

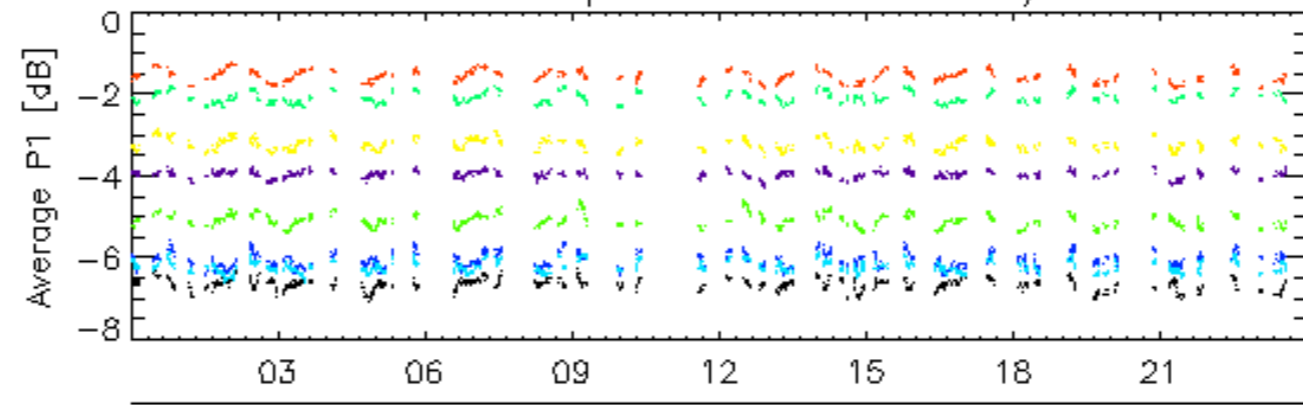


07-Jan

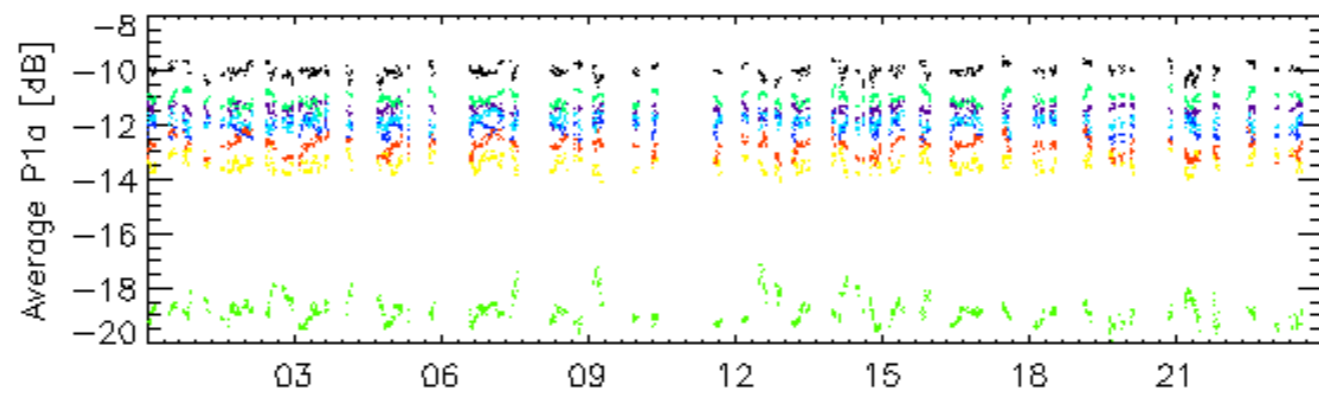

07-Jan

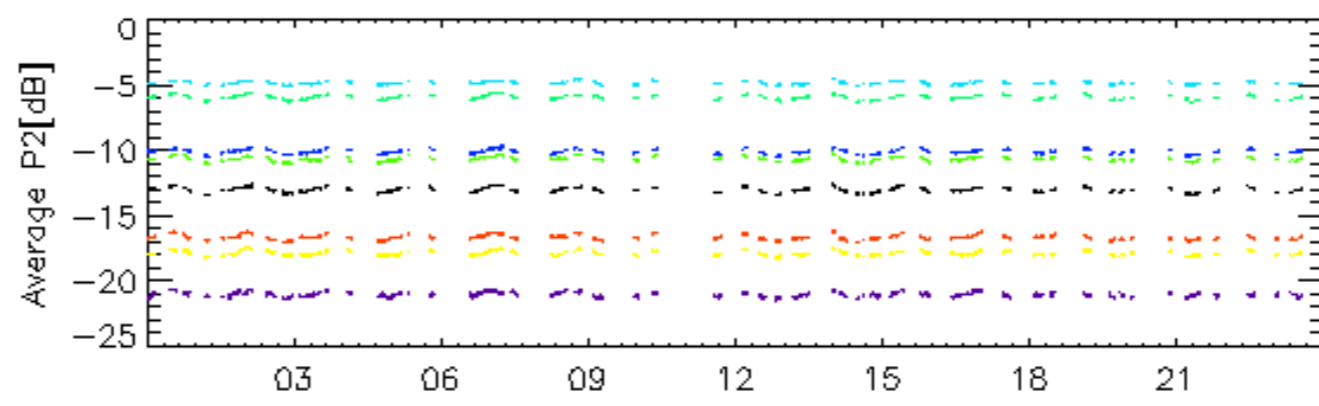


07-Jan

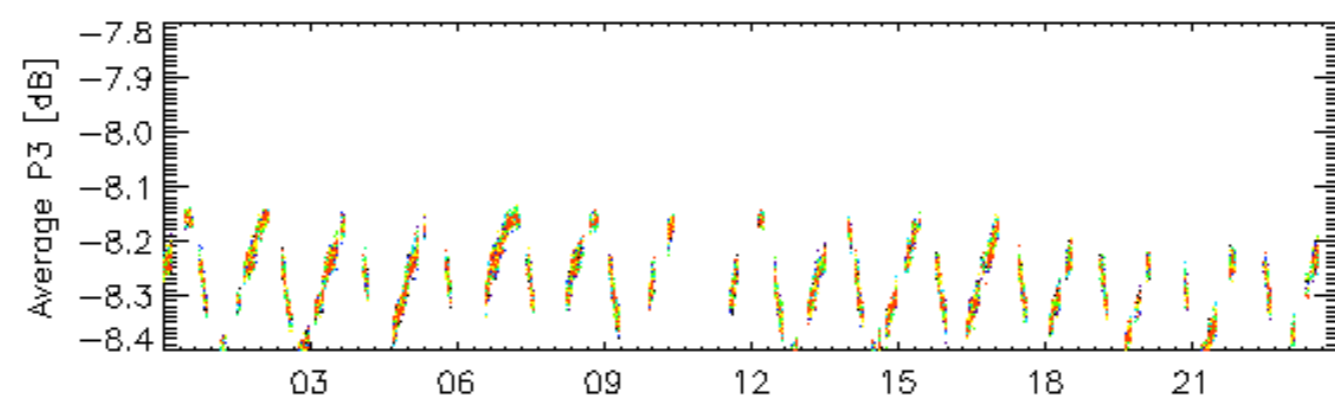


07-Jan

rows: _ 4 _ 8 _ 12 _ 16 _ 20 _ 24 _ 28 _ 32


Calibration pulses for WVS IS2 V/V

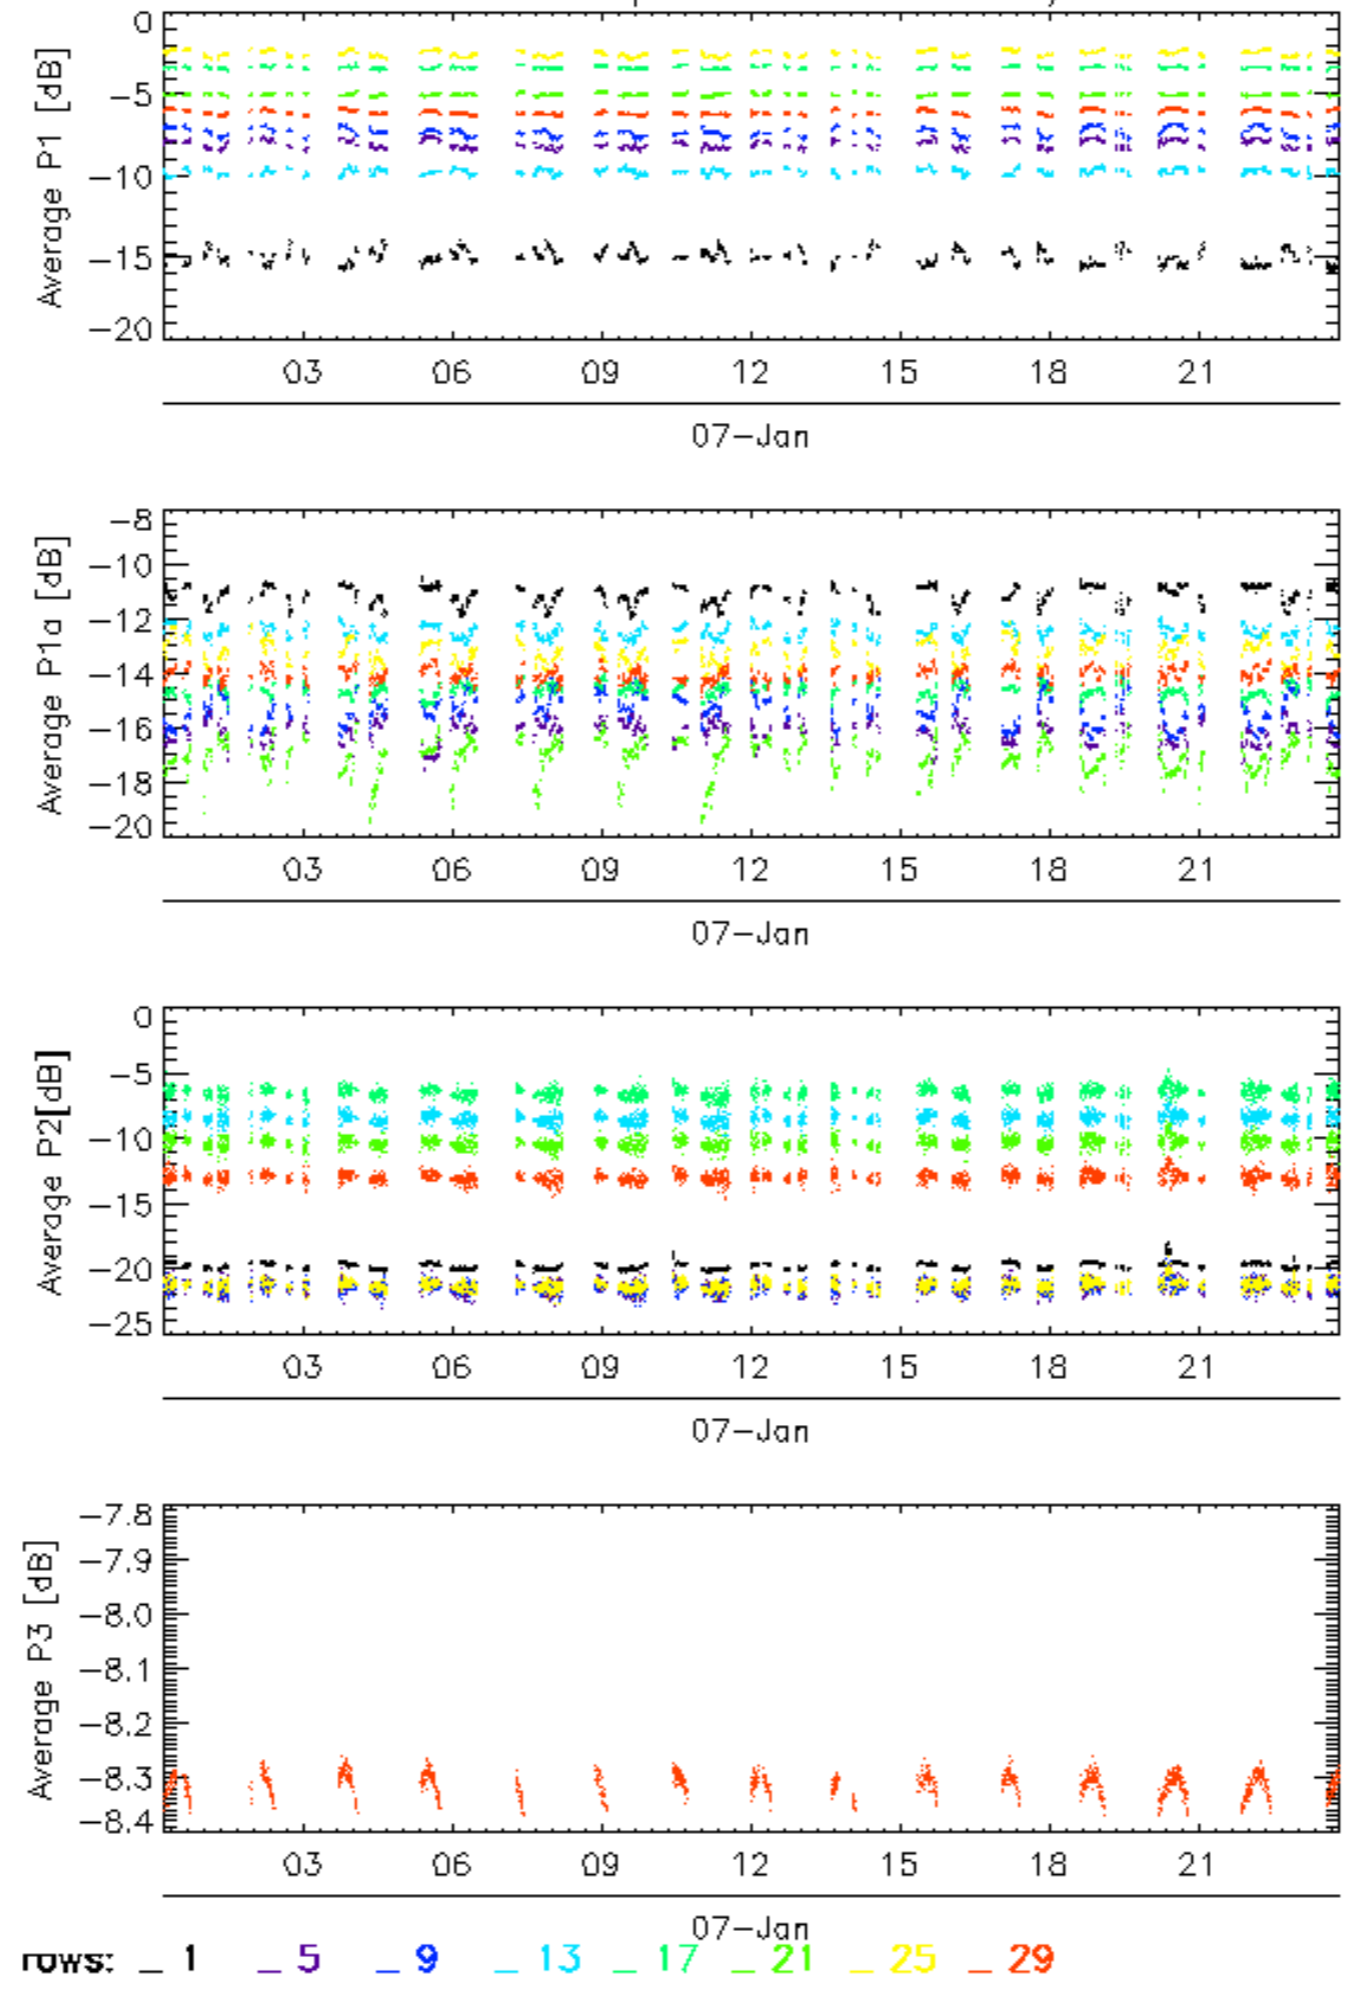


Calibration pulses for WVS IS2 V/V

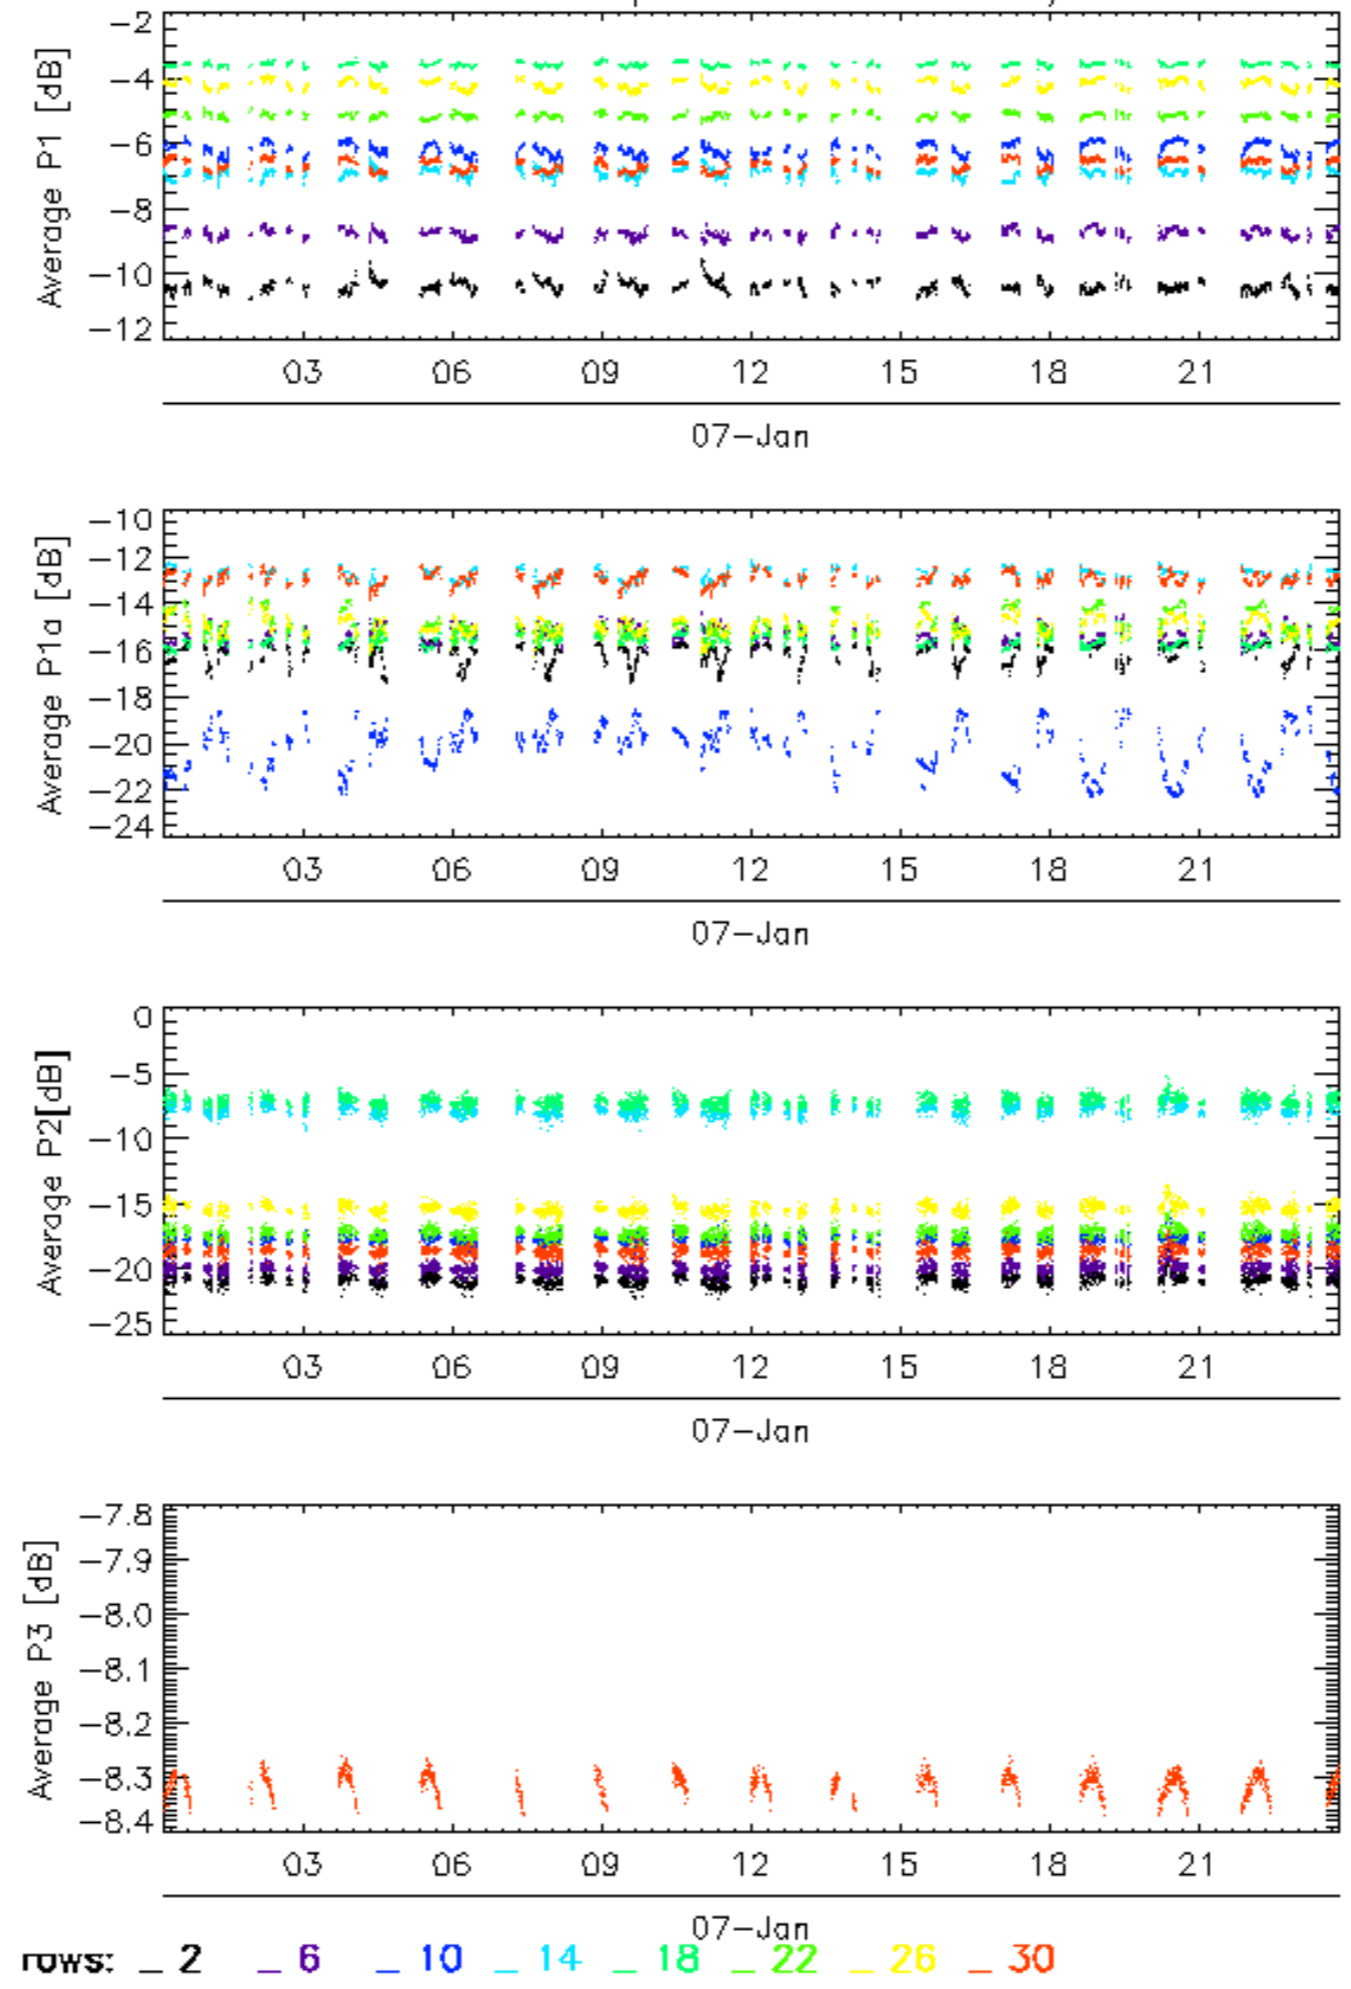


Calibration pulses for WVS IS2 V/V

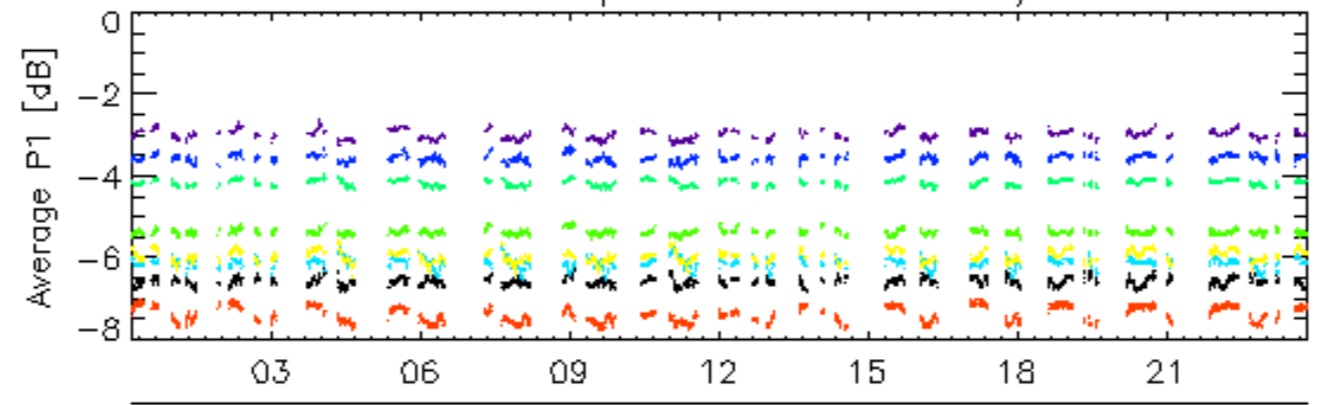


07-Jan

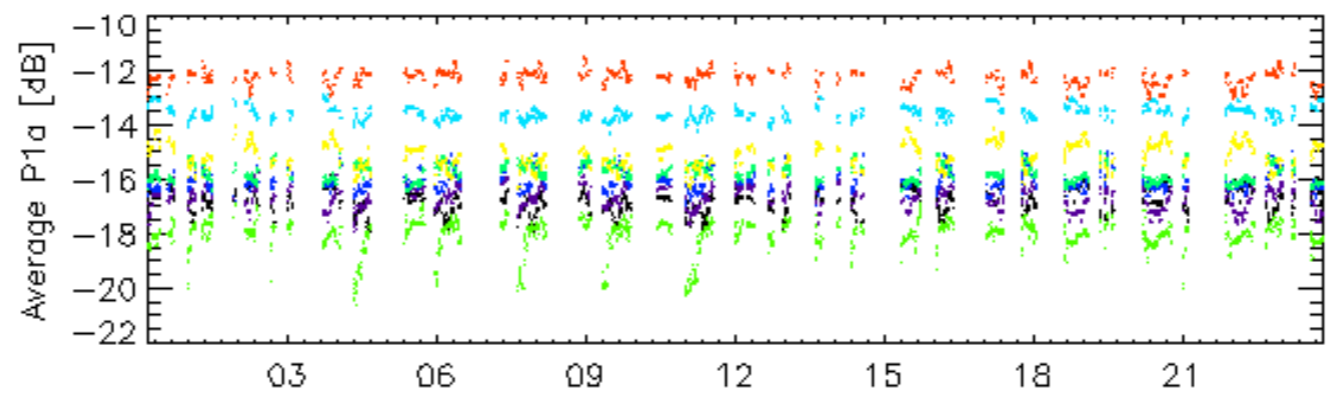

07-Jan

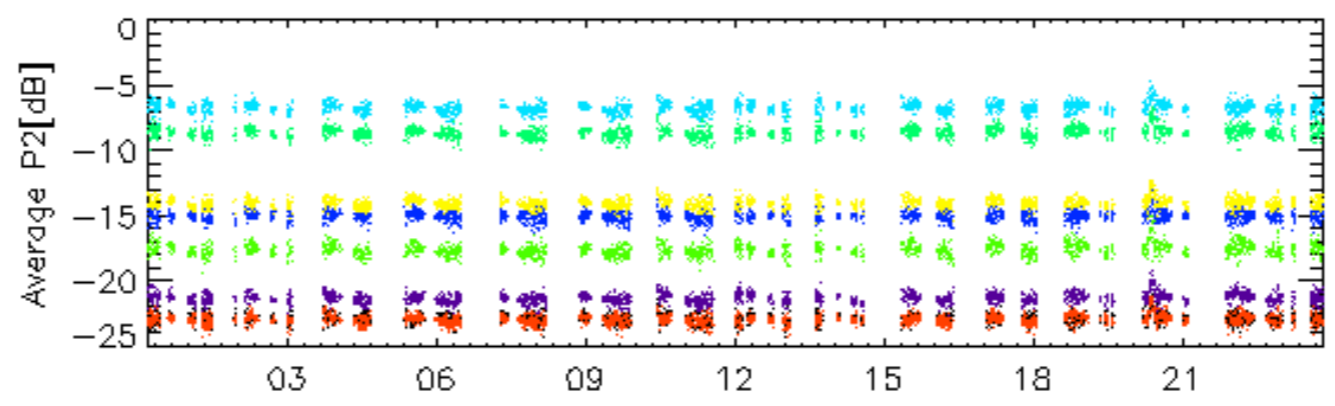


07-Jan

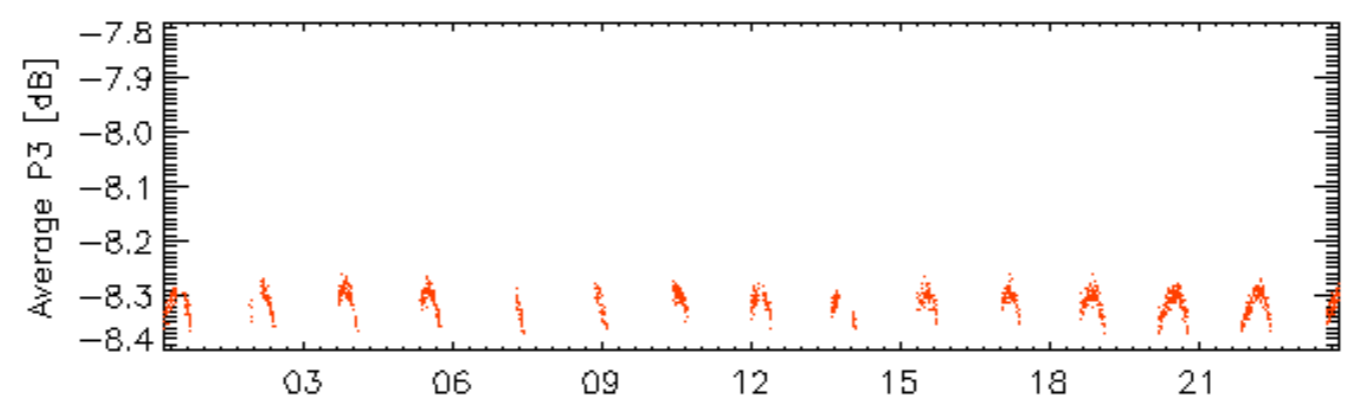


07-Jan

rows: _ 3 _ 7 _ 11 _ 15 _ 19 _ 23 _ 27 _ 31


Calibration pulses for WVS IS2 V/V

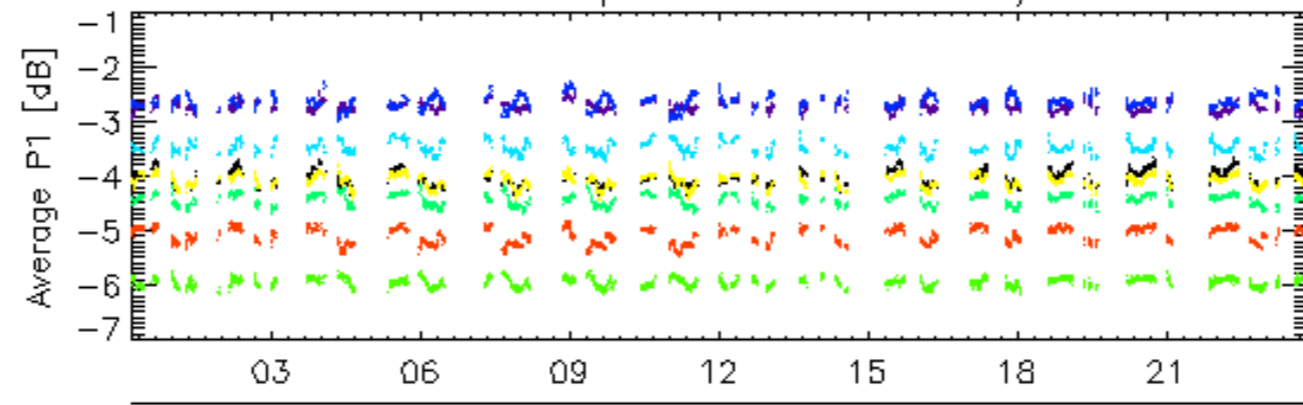


07-Jan

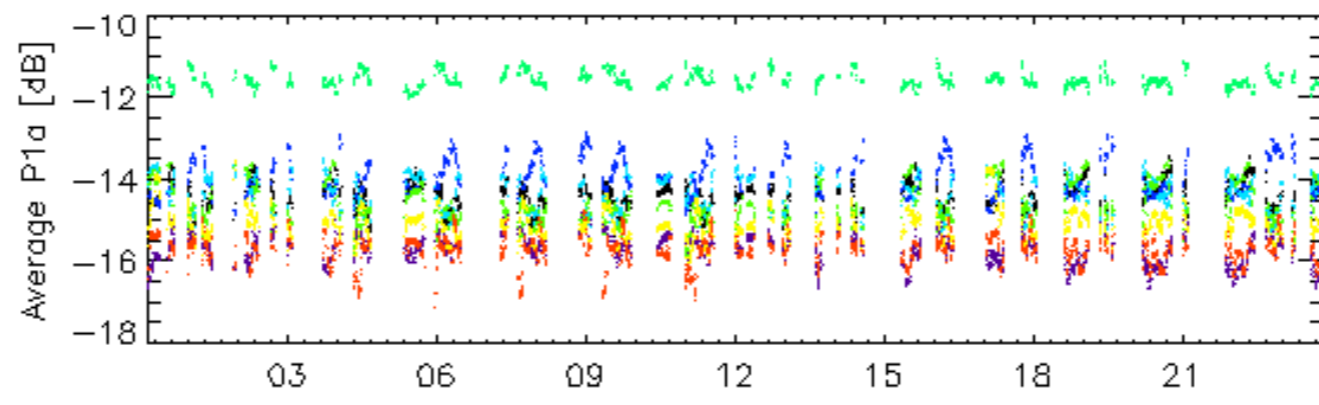

07-Jan

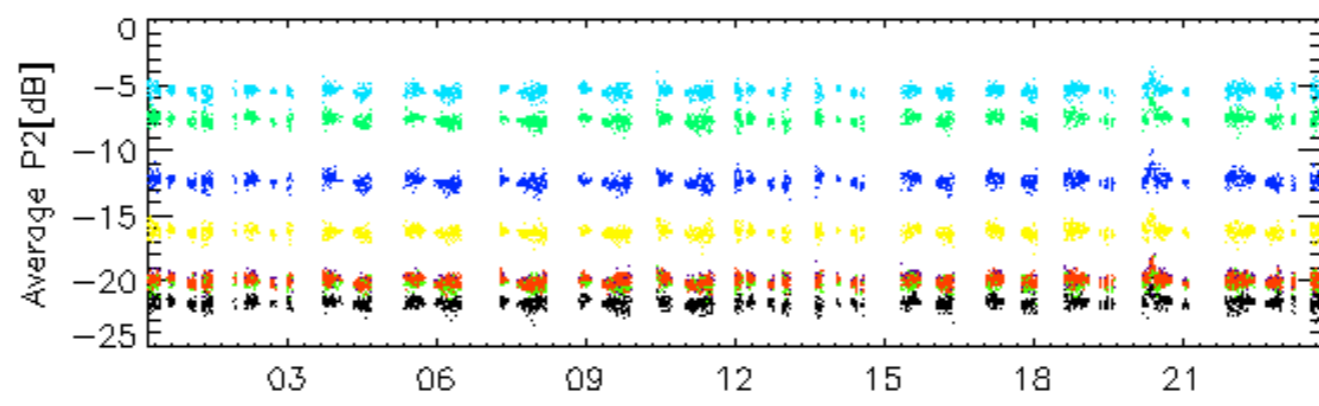



07-Jan


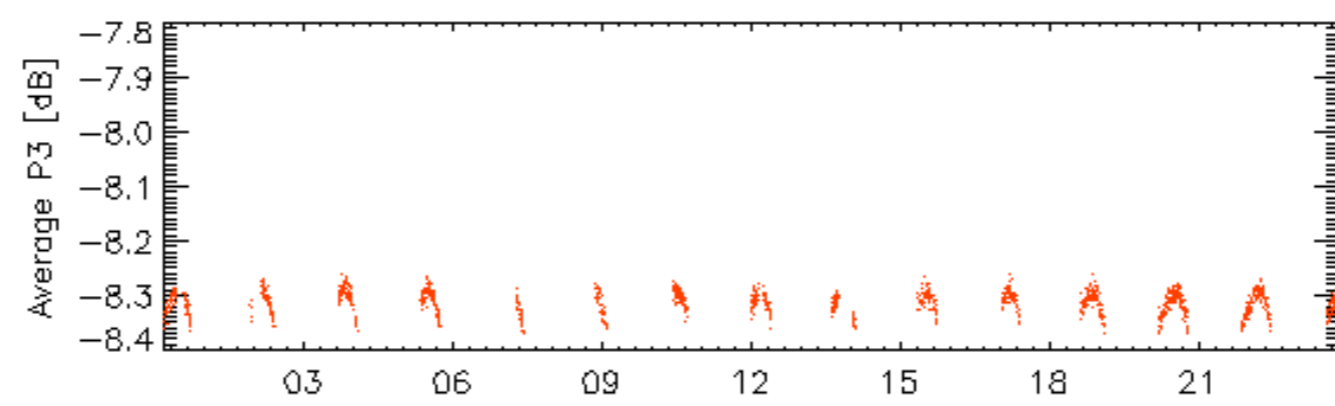




07-Jan



rows: _ 4 _ 8 _ 12 _ 16 _ 20 _ 24 _ 28 _ 32


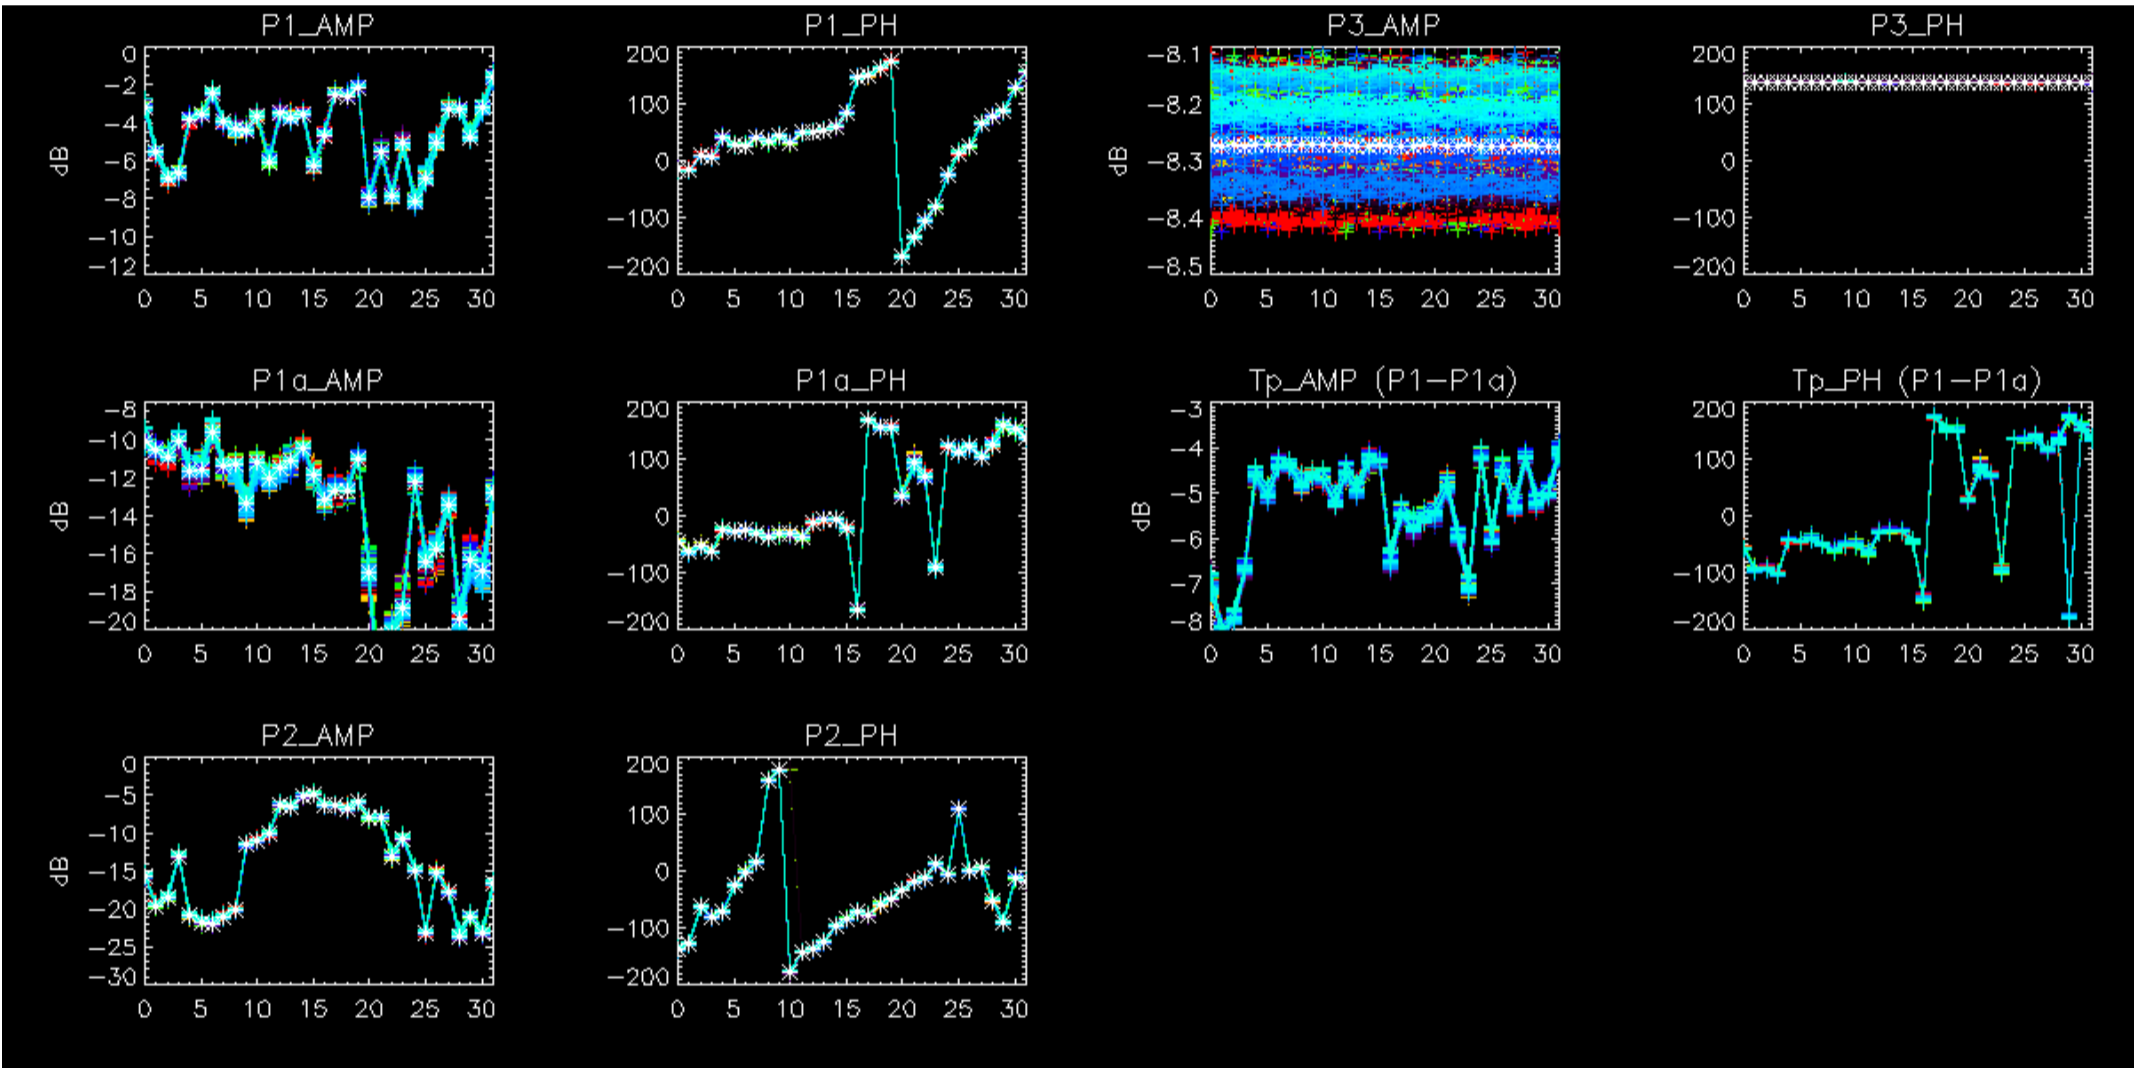



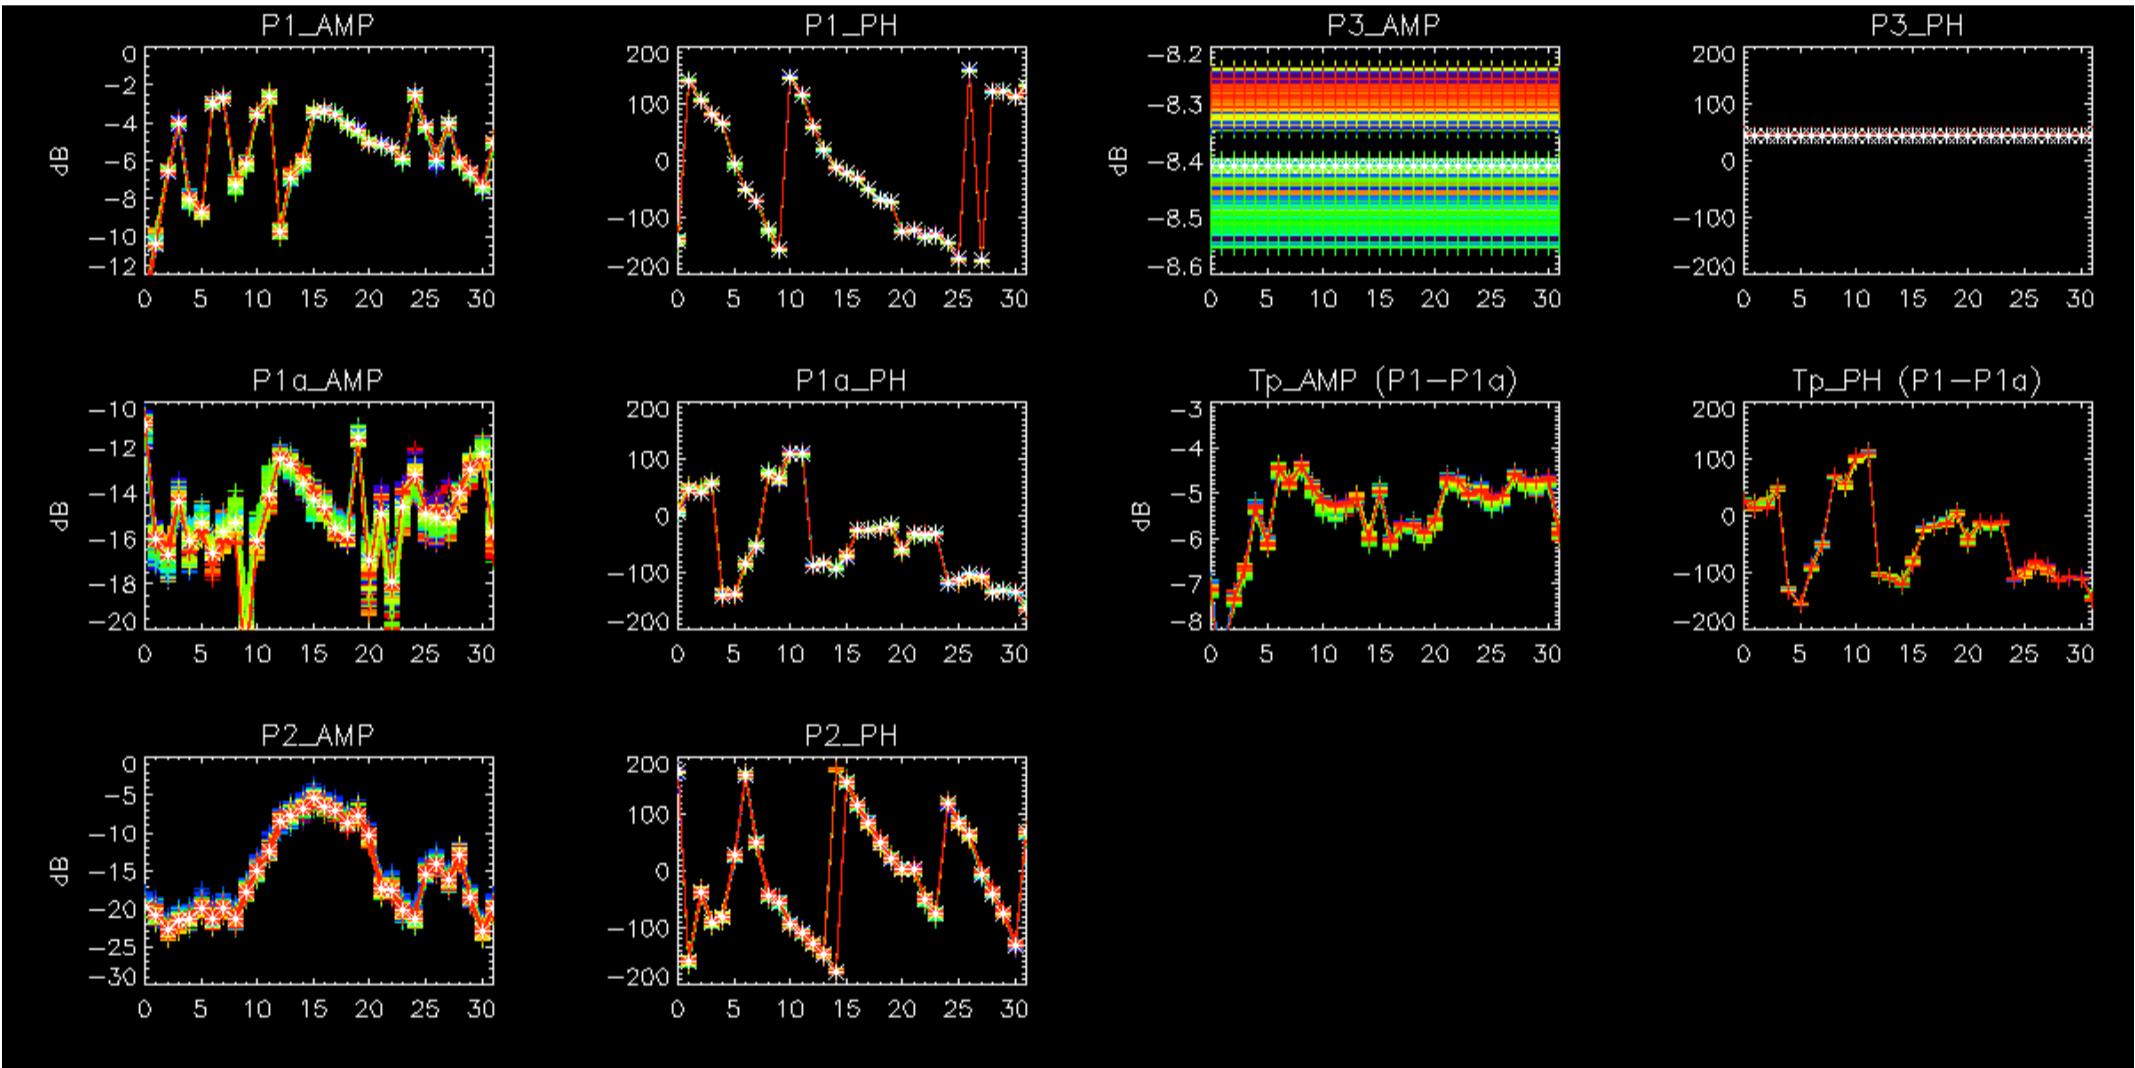


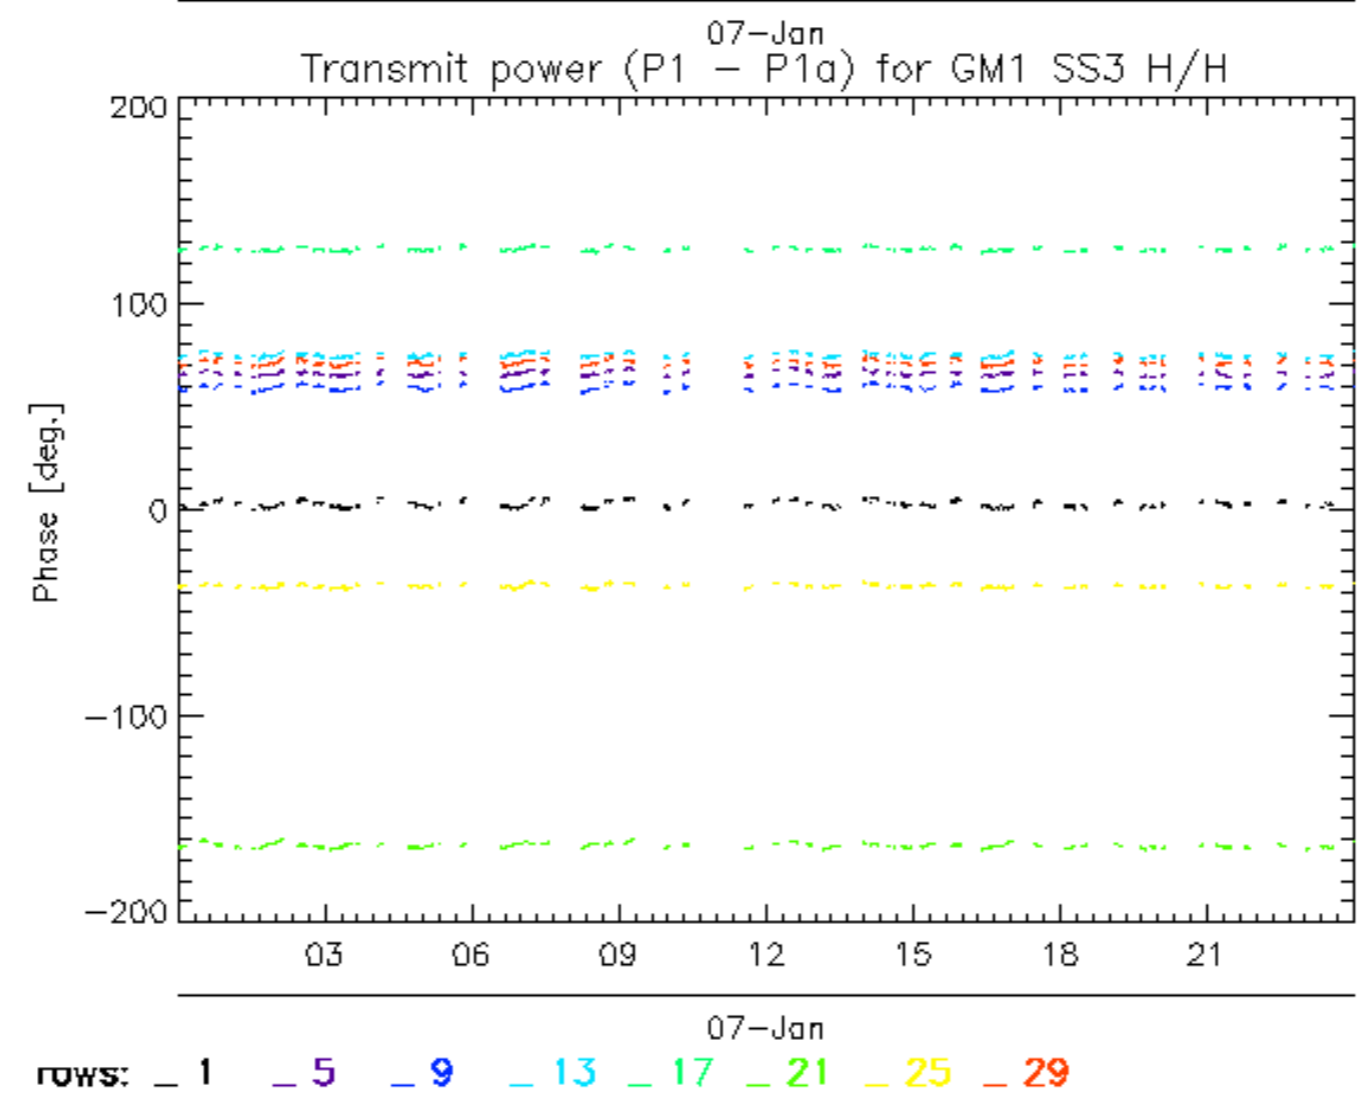
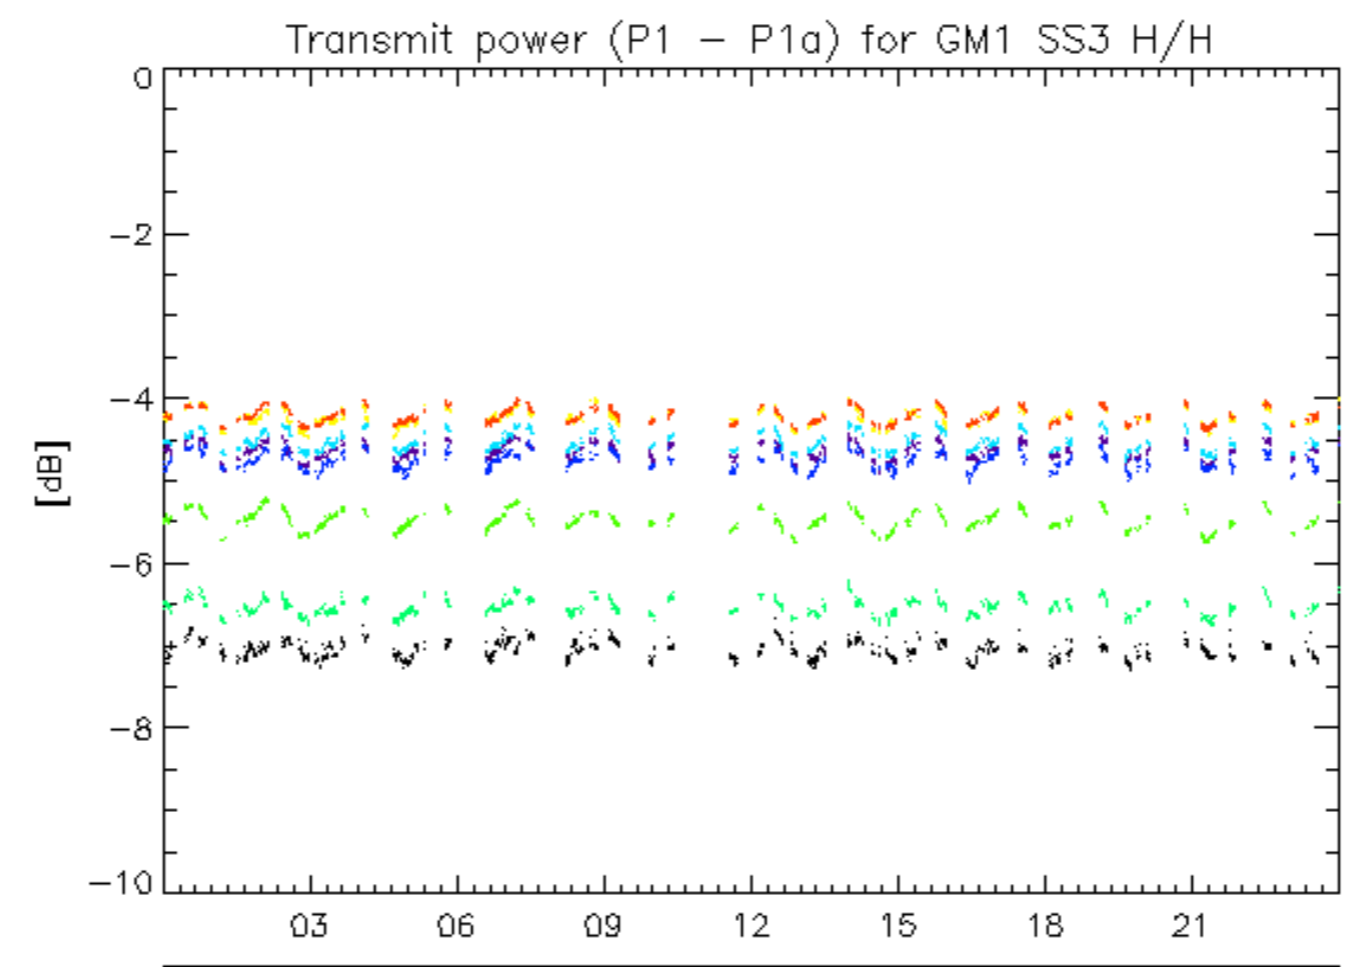


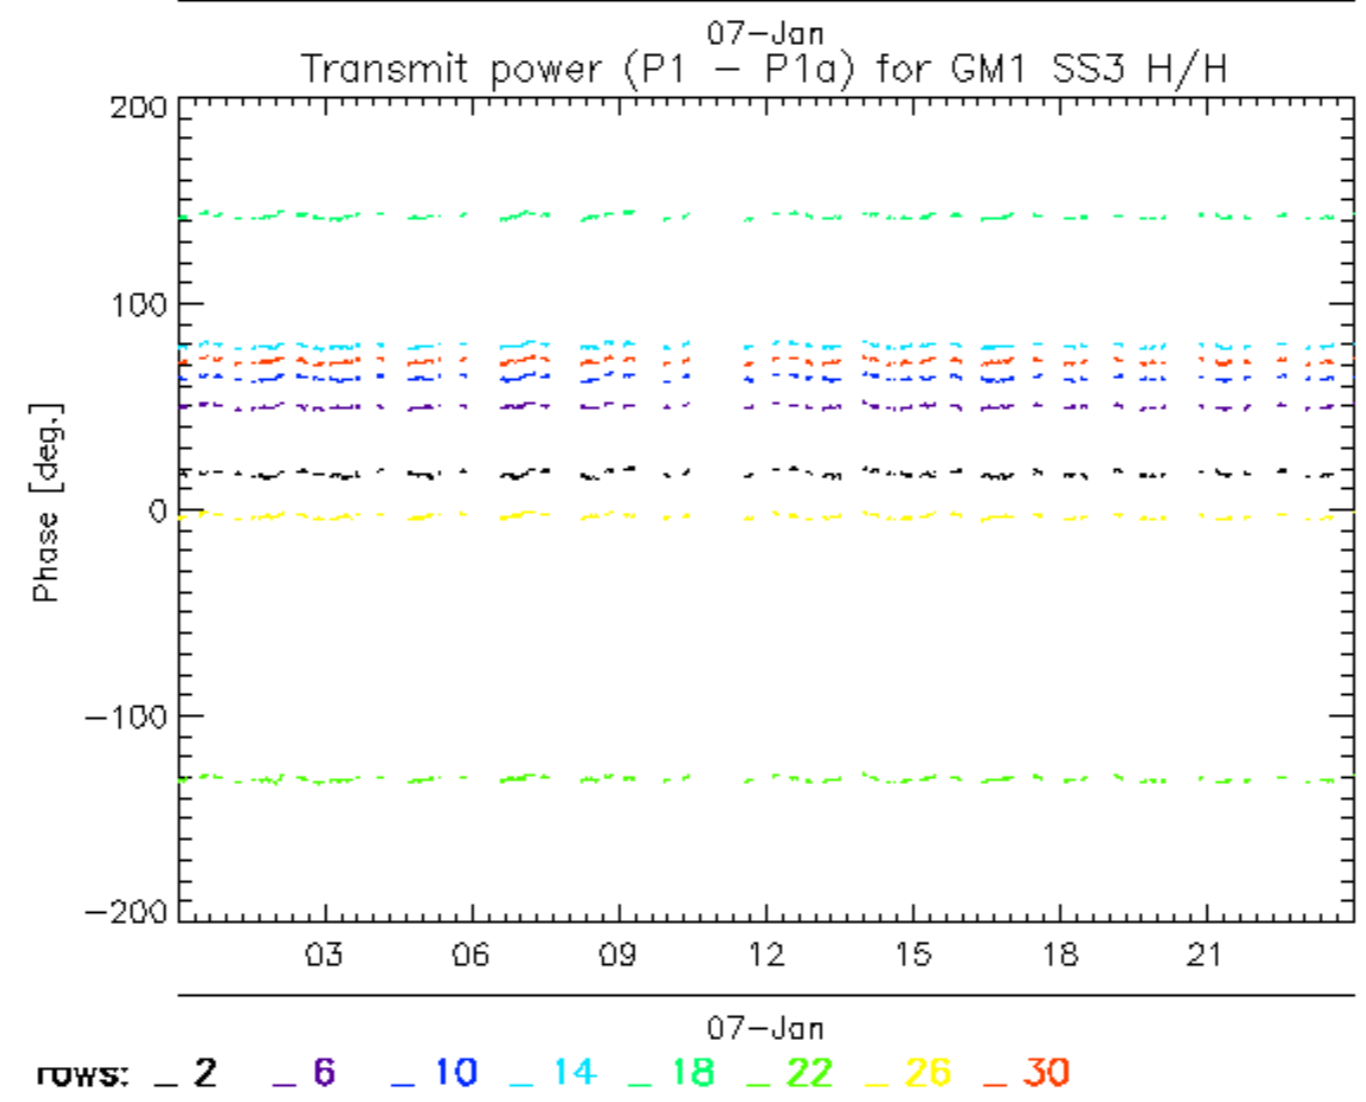
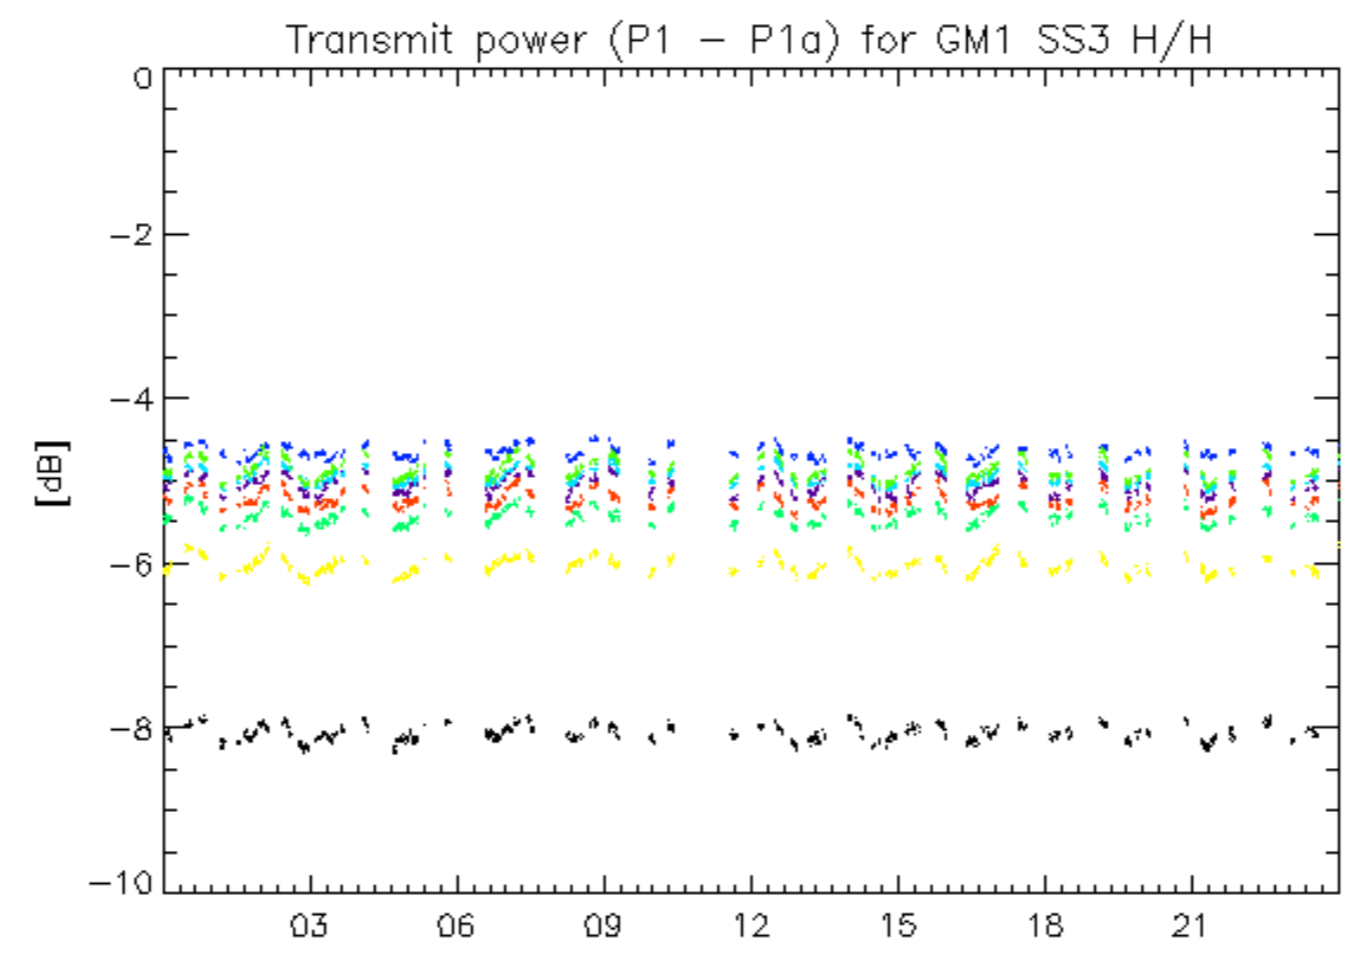


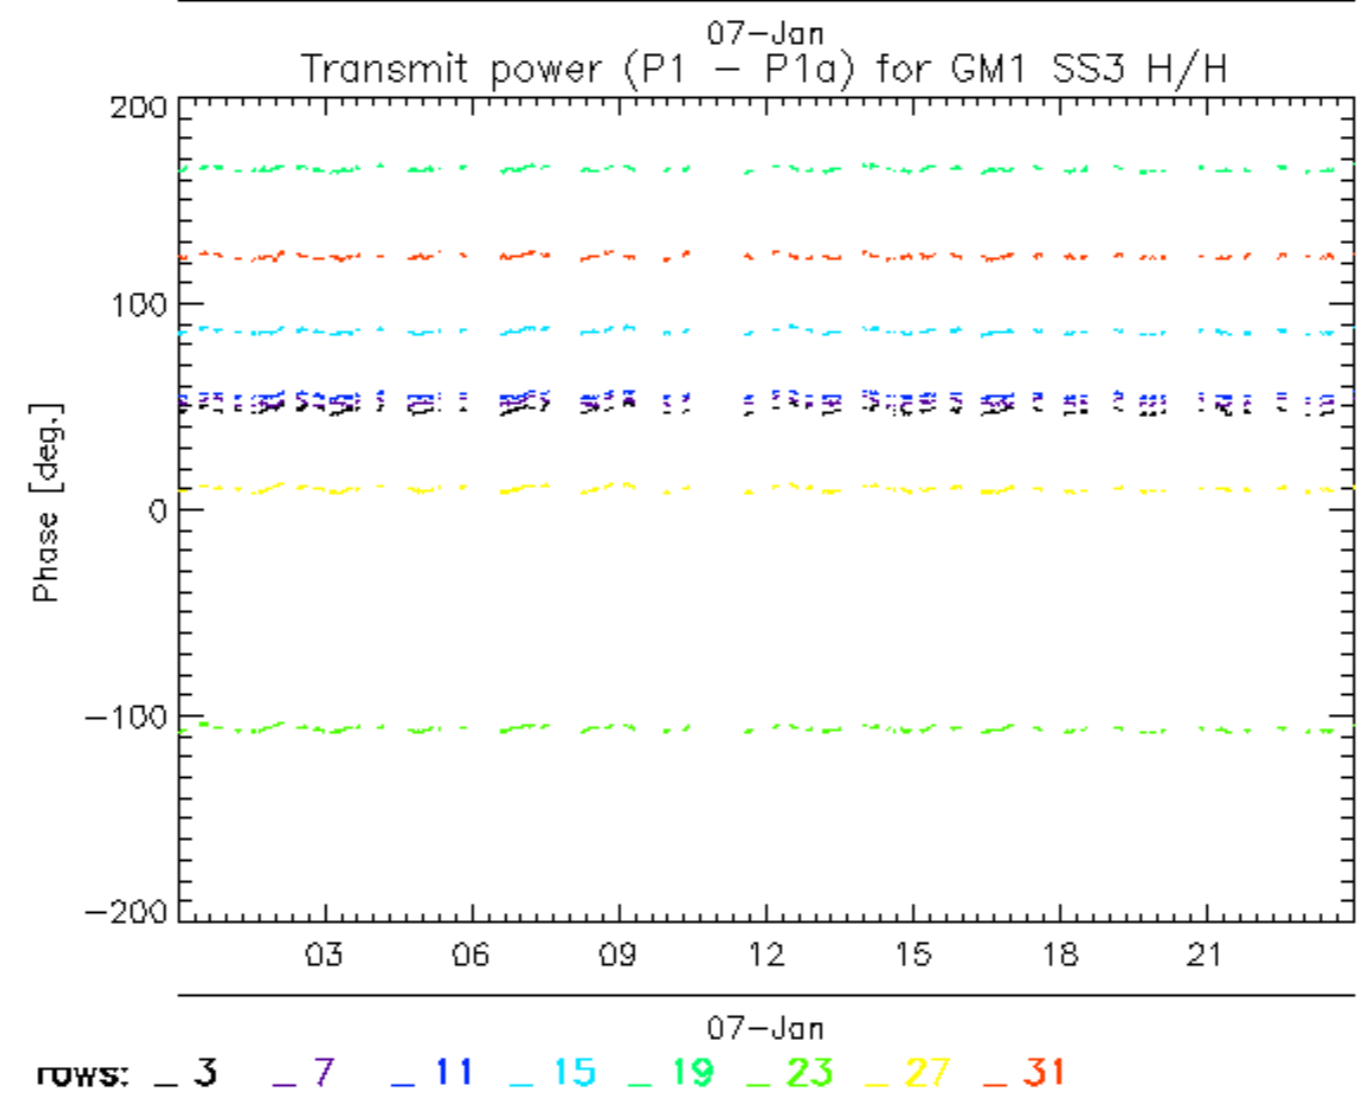
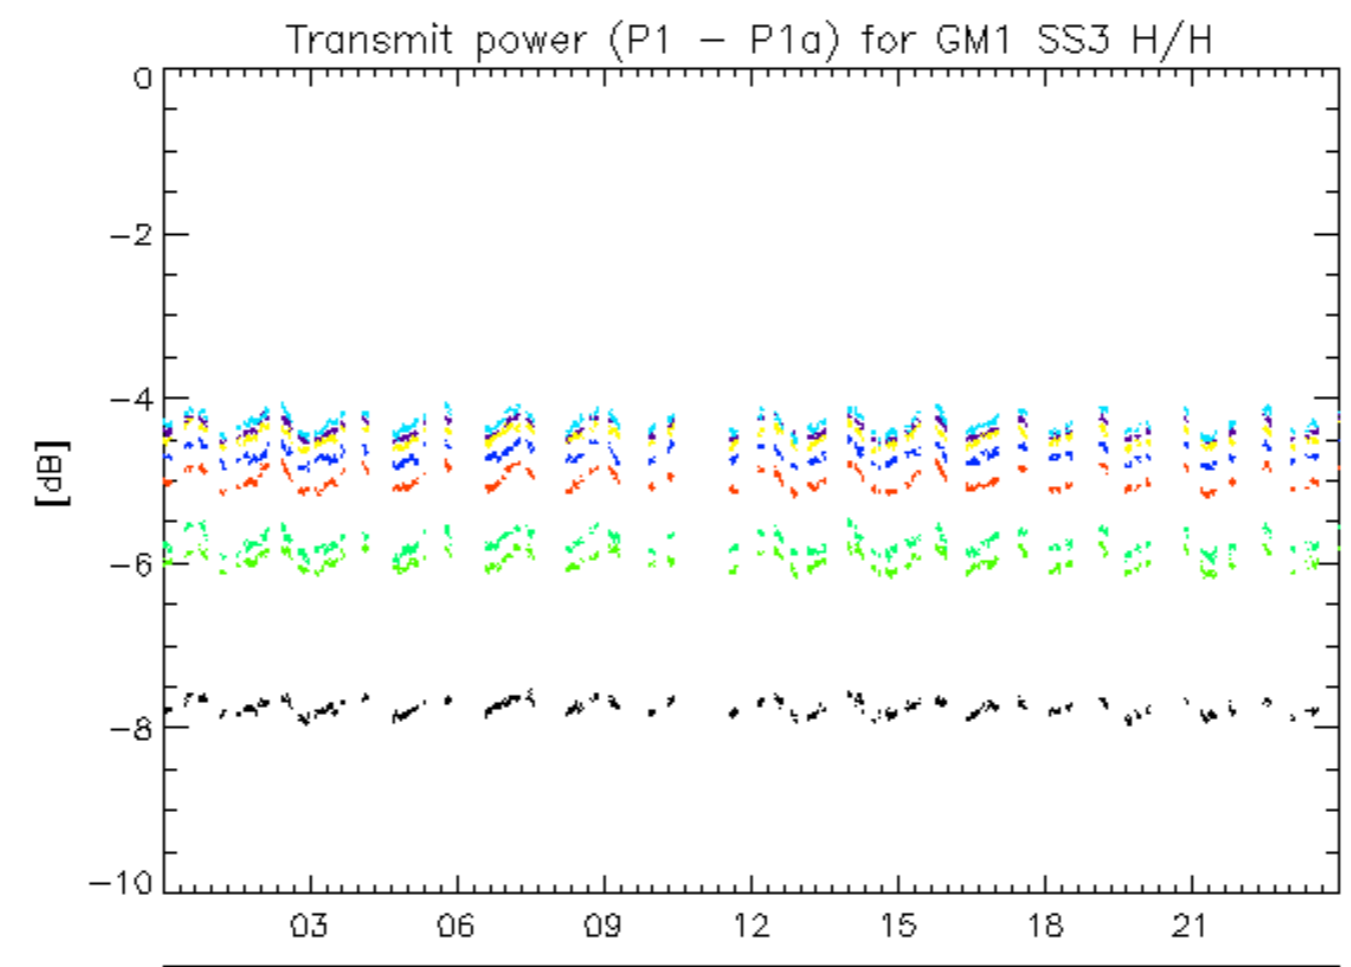


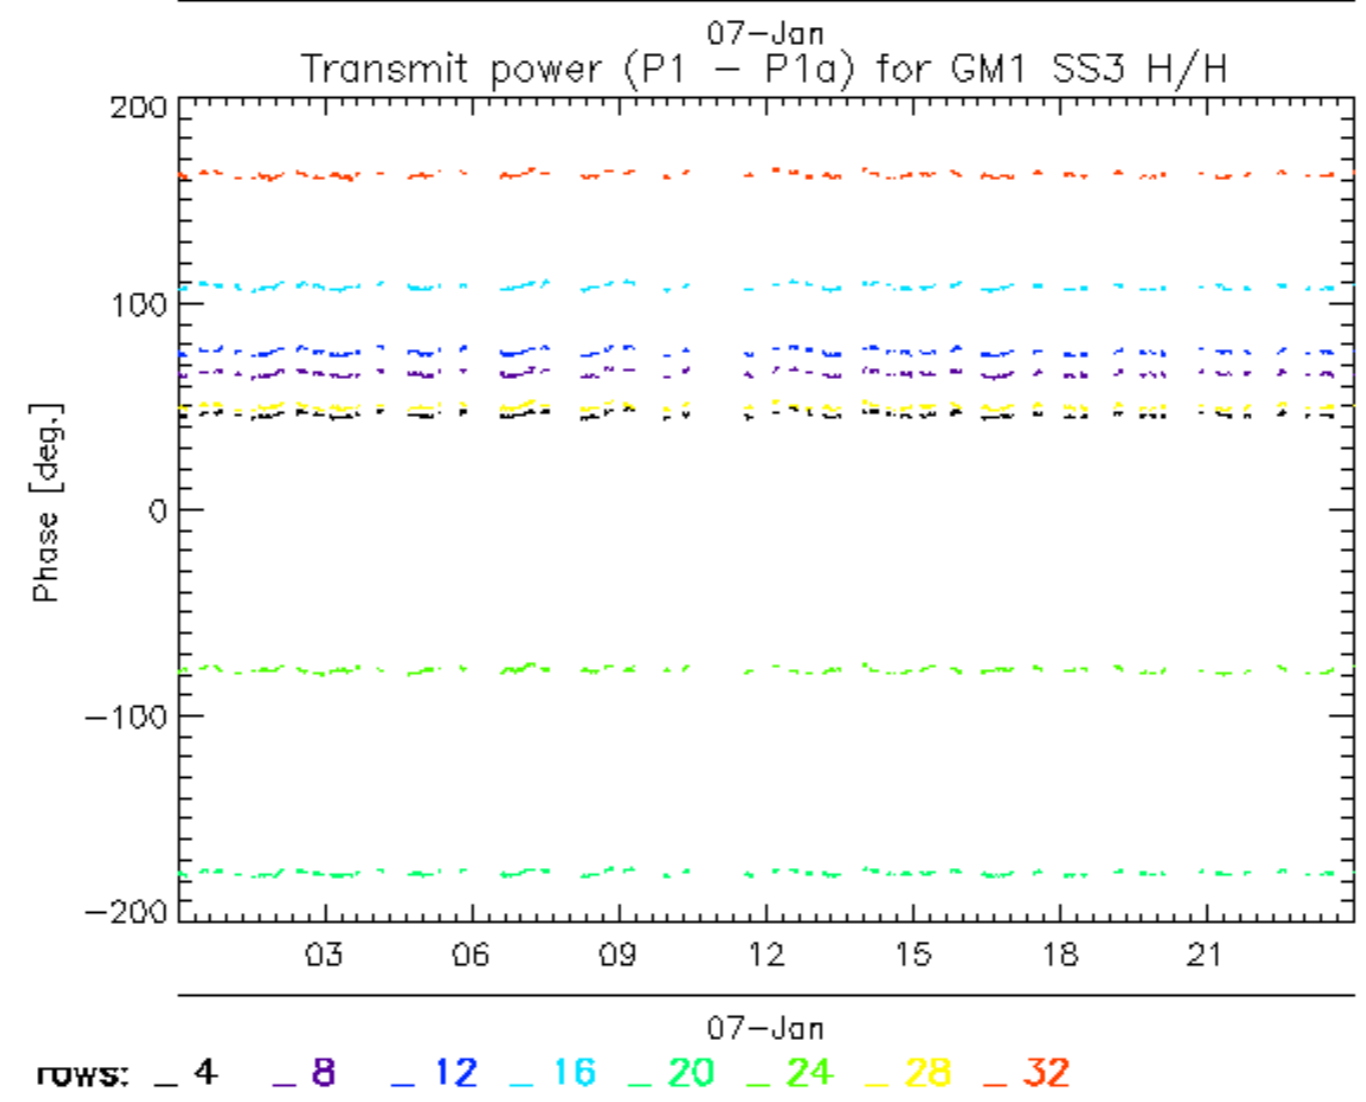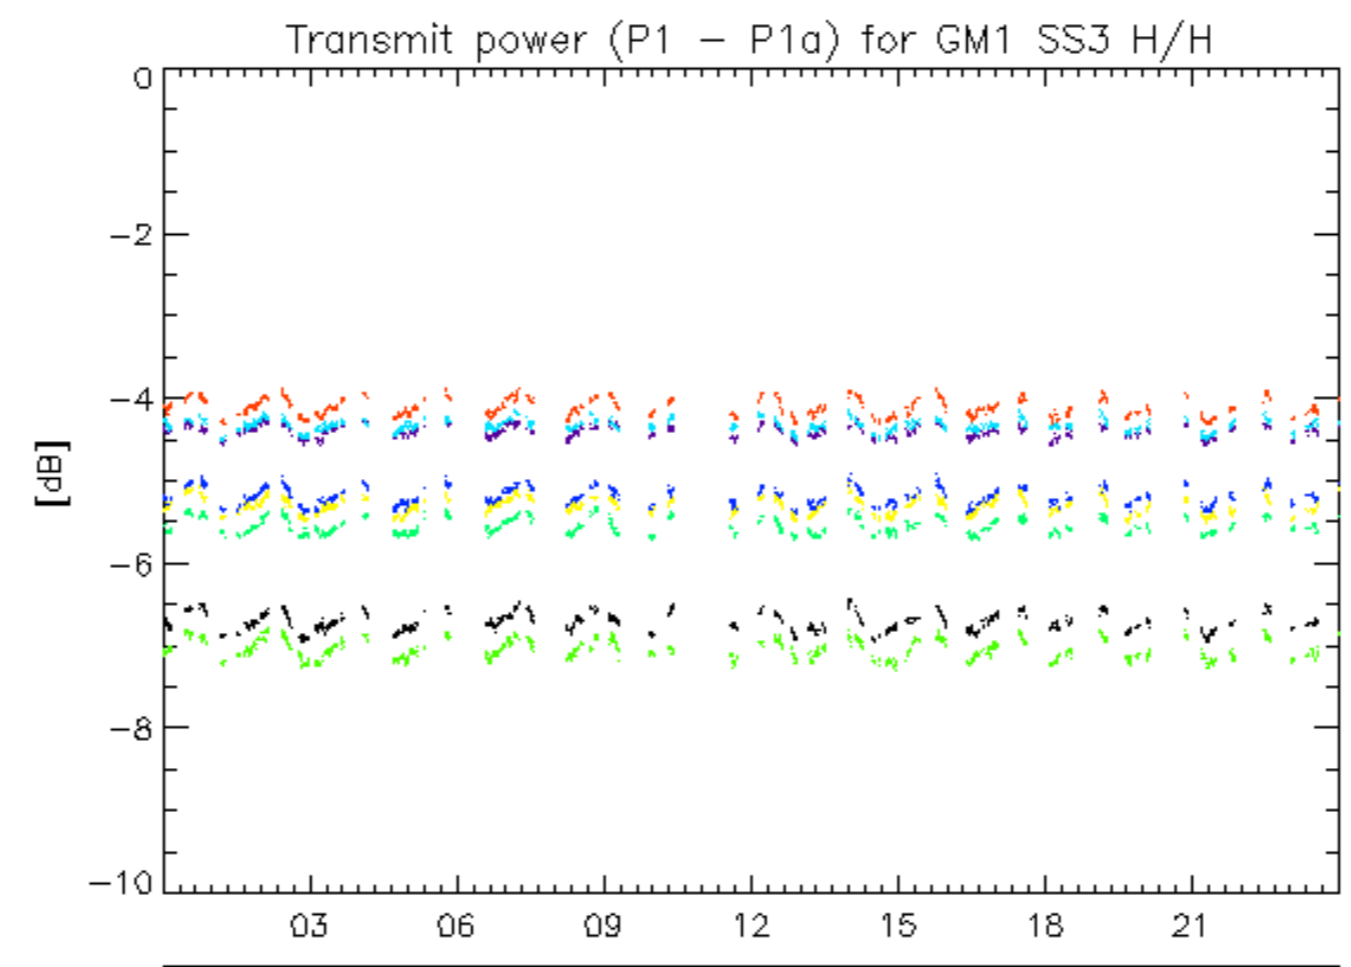


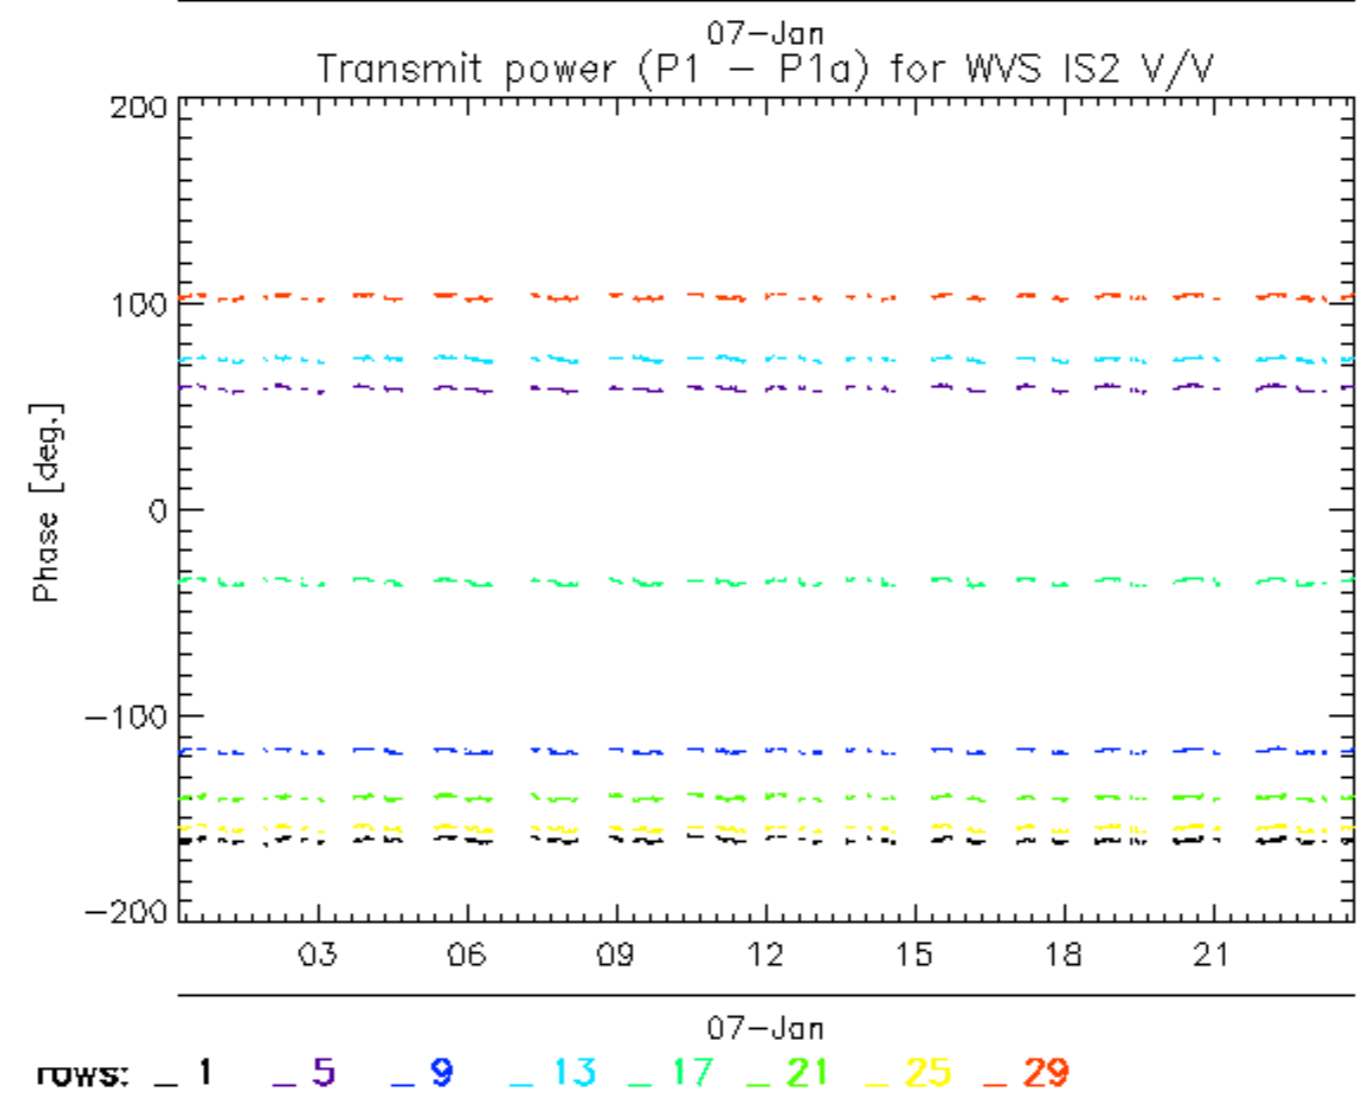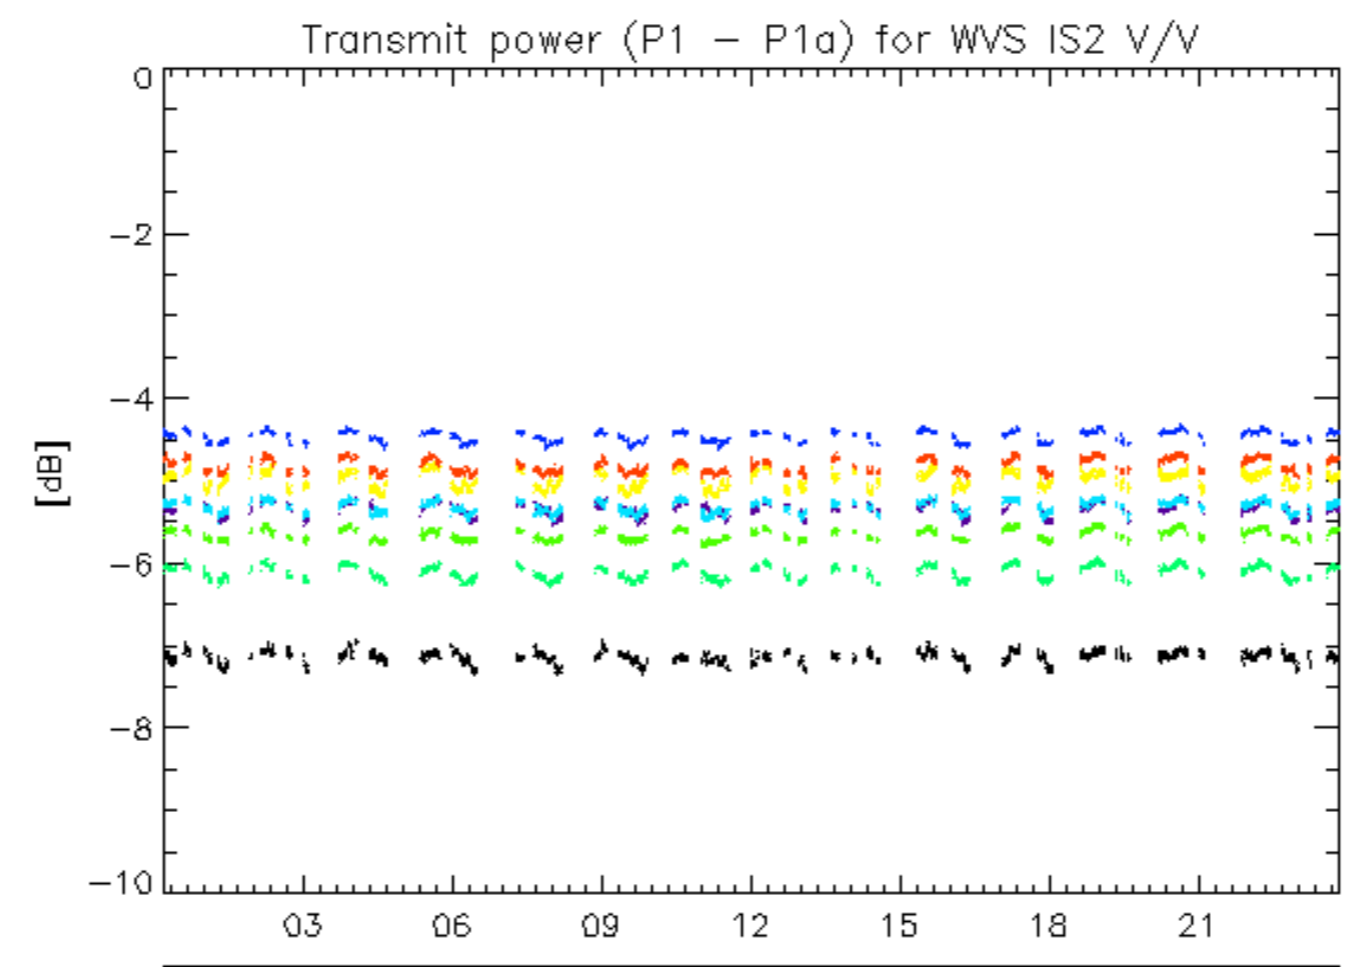


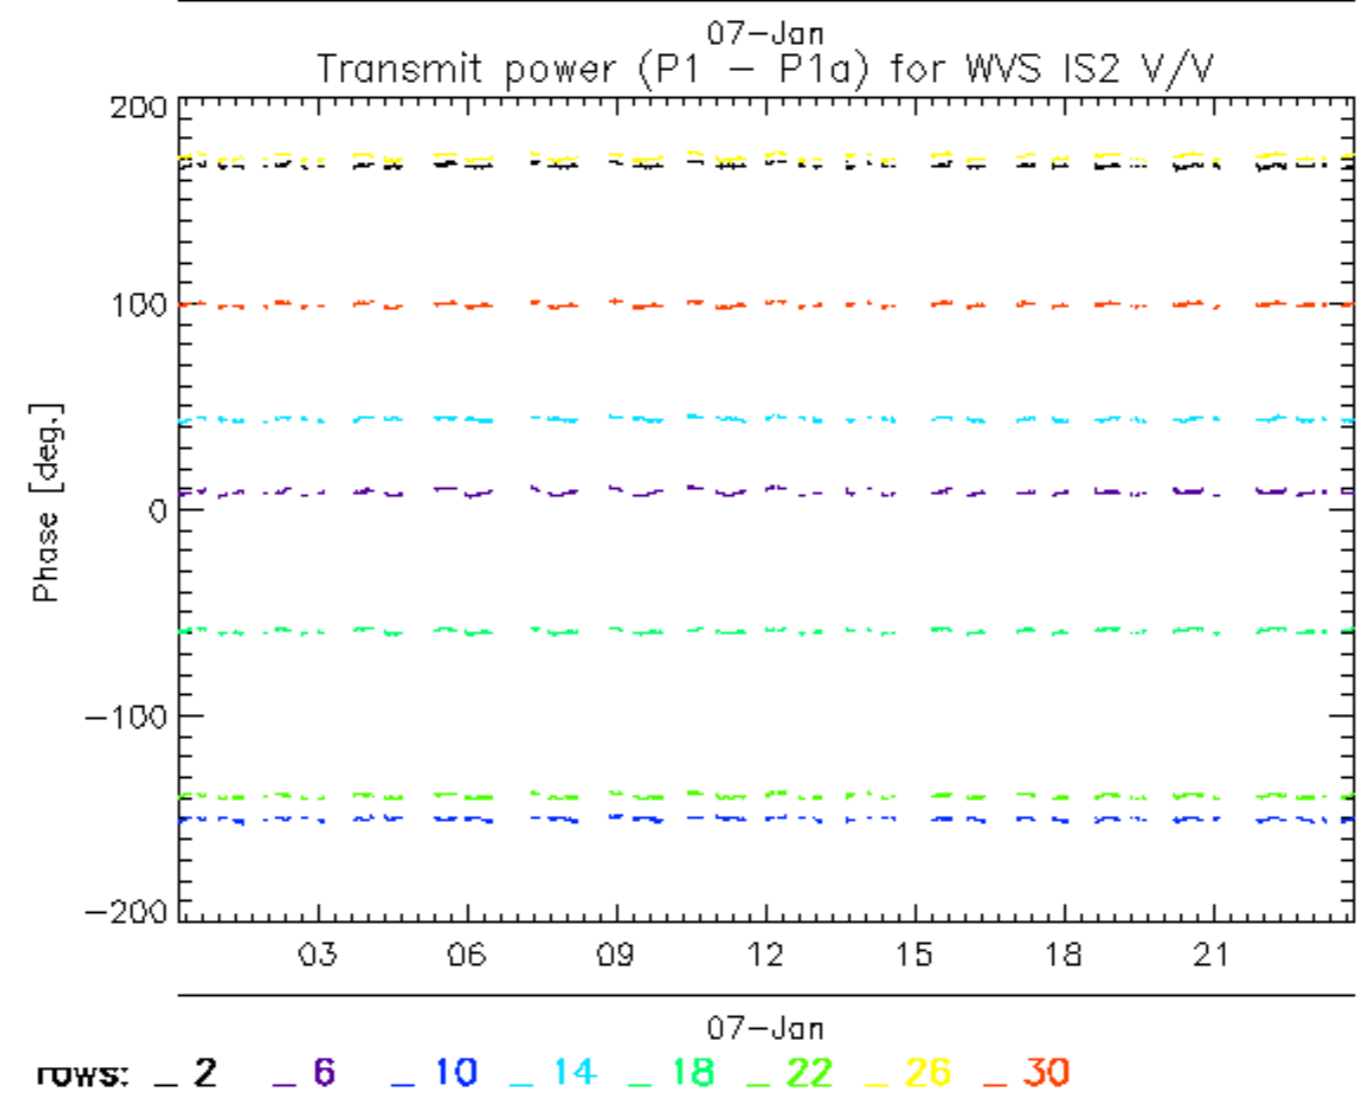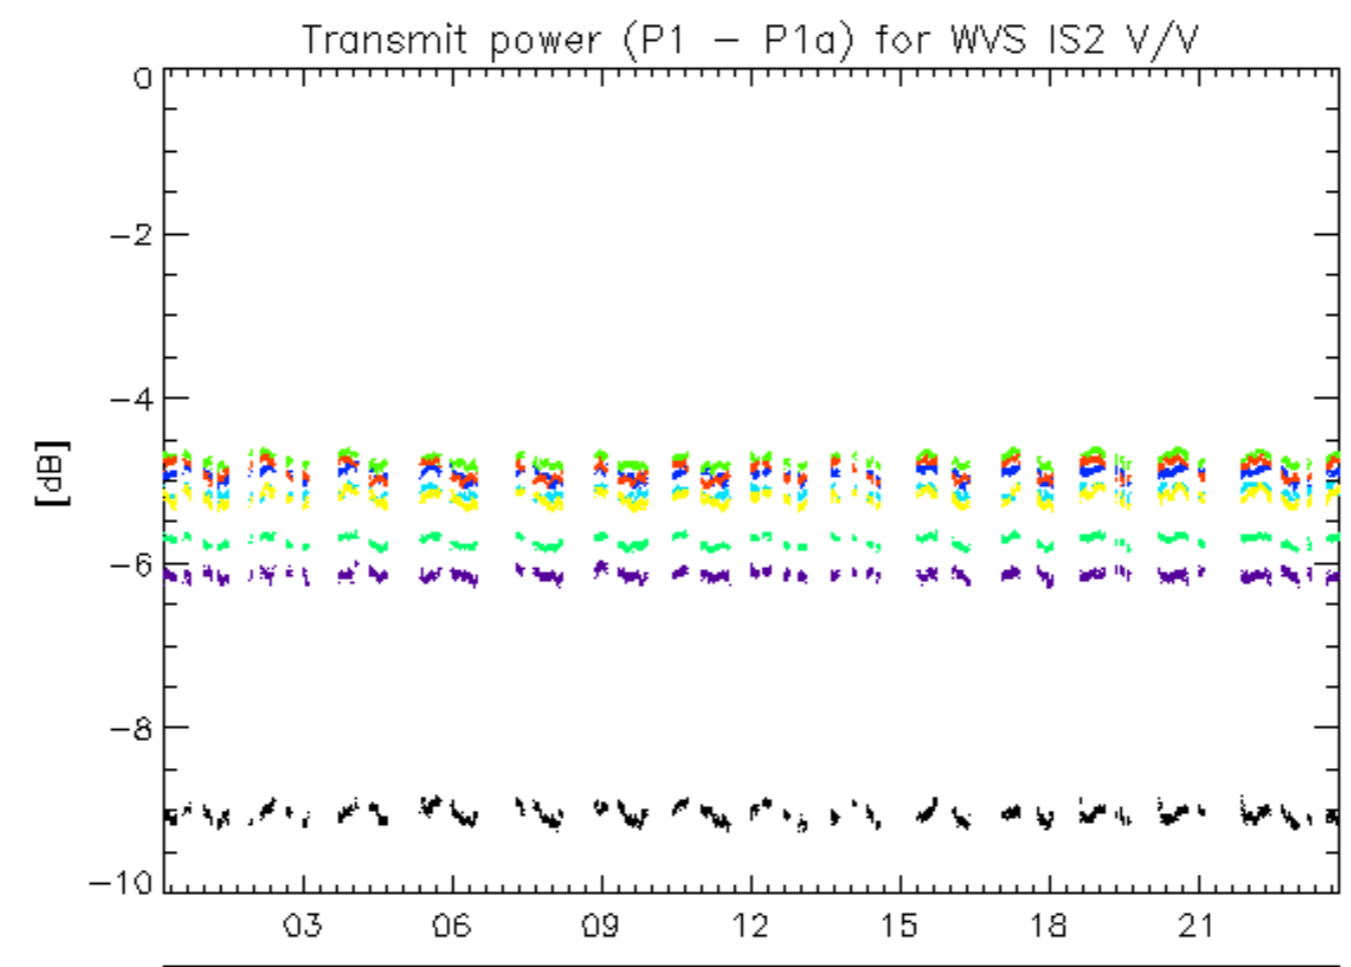


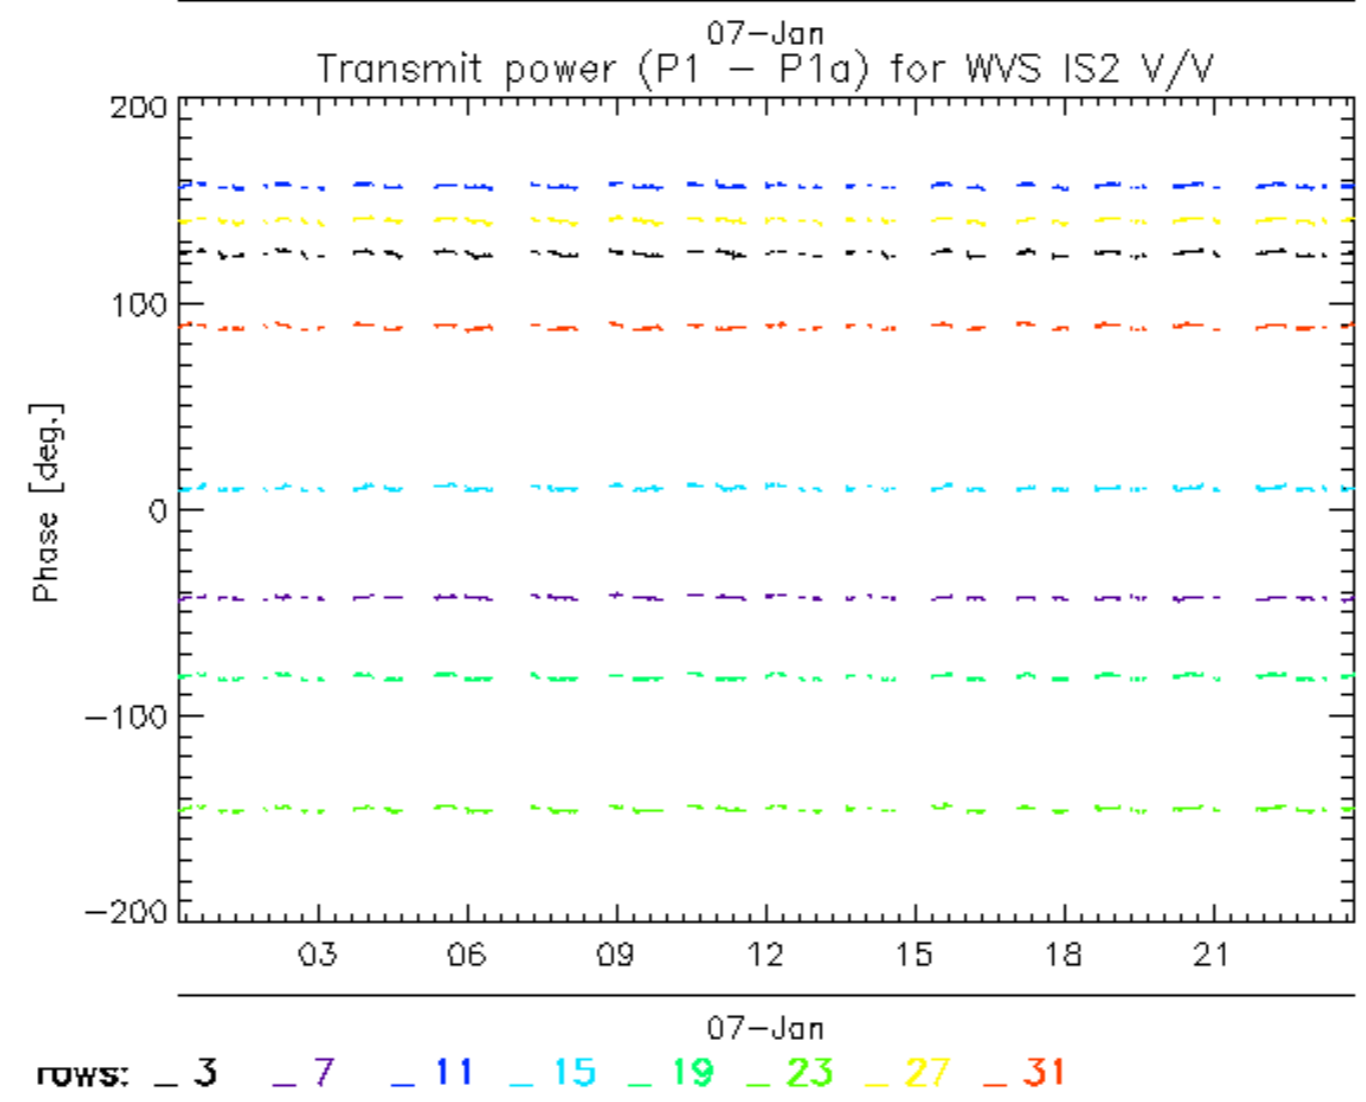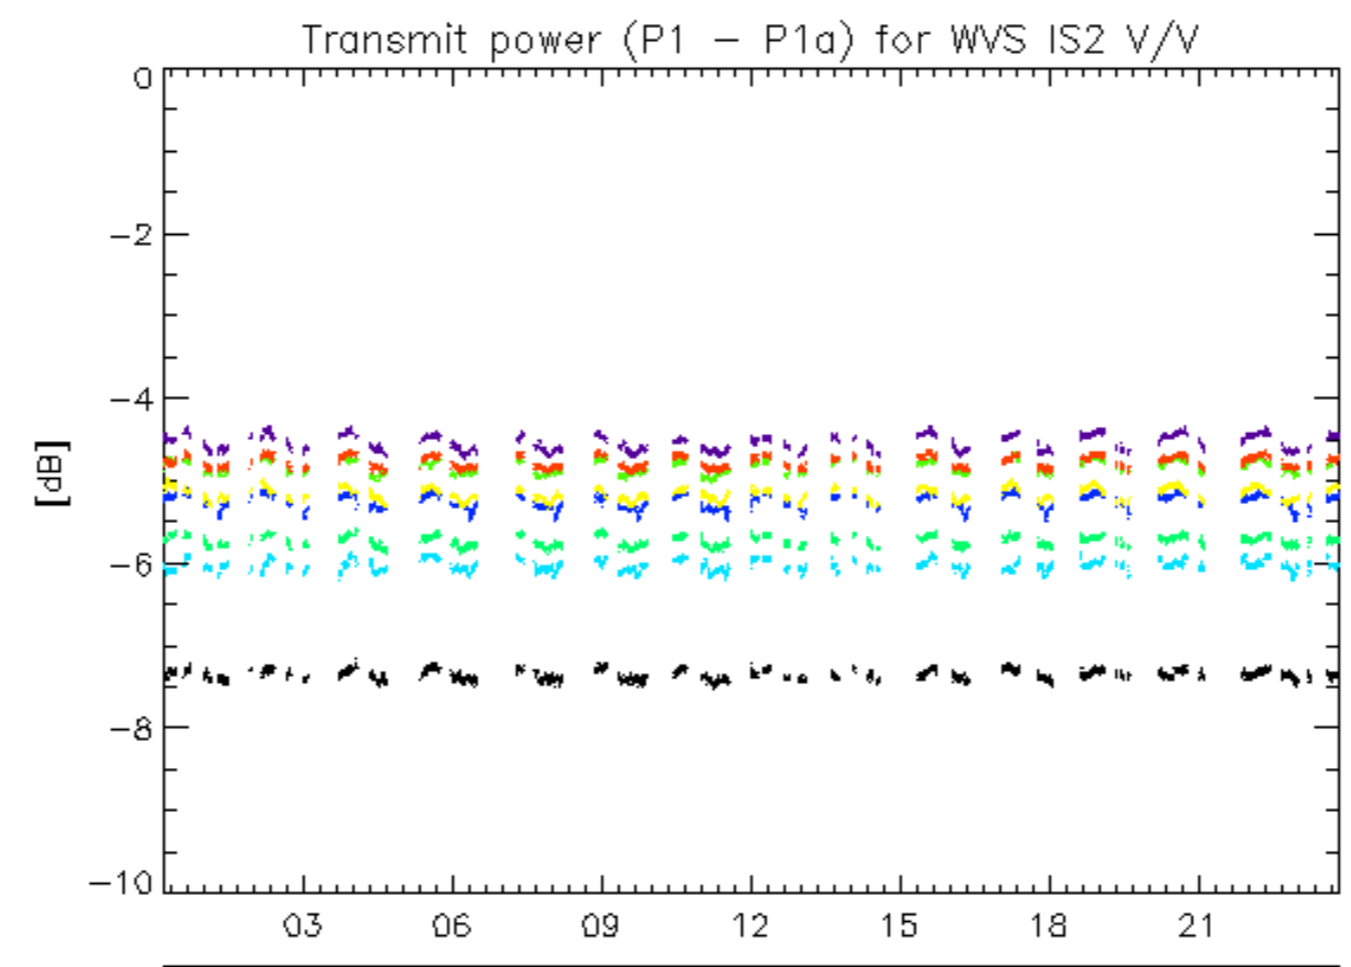


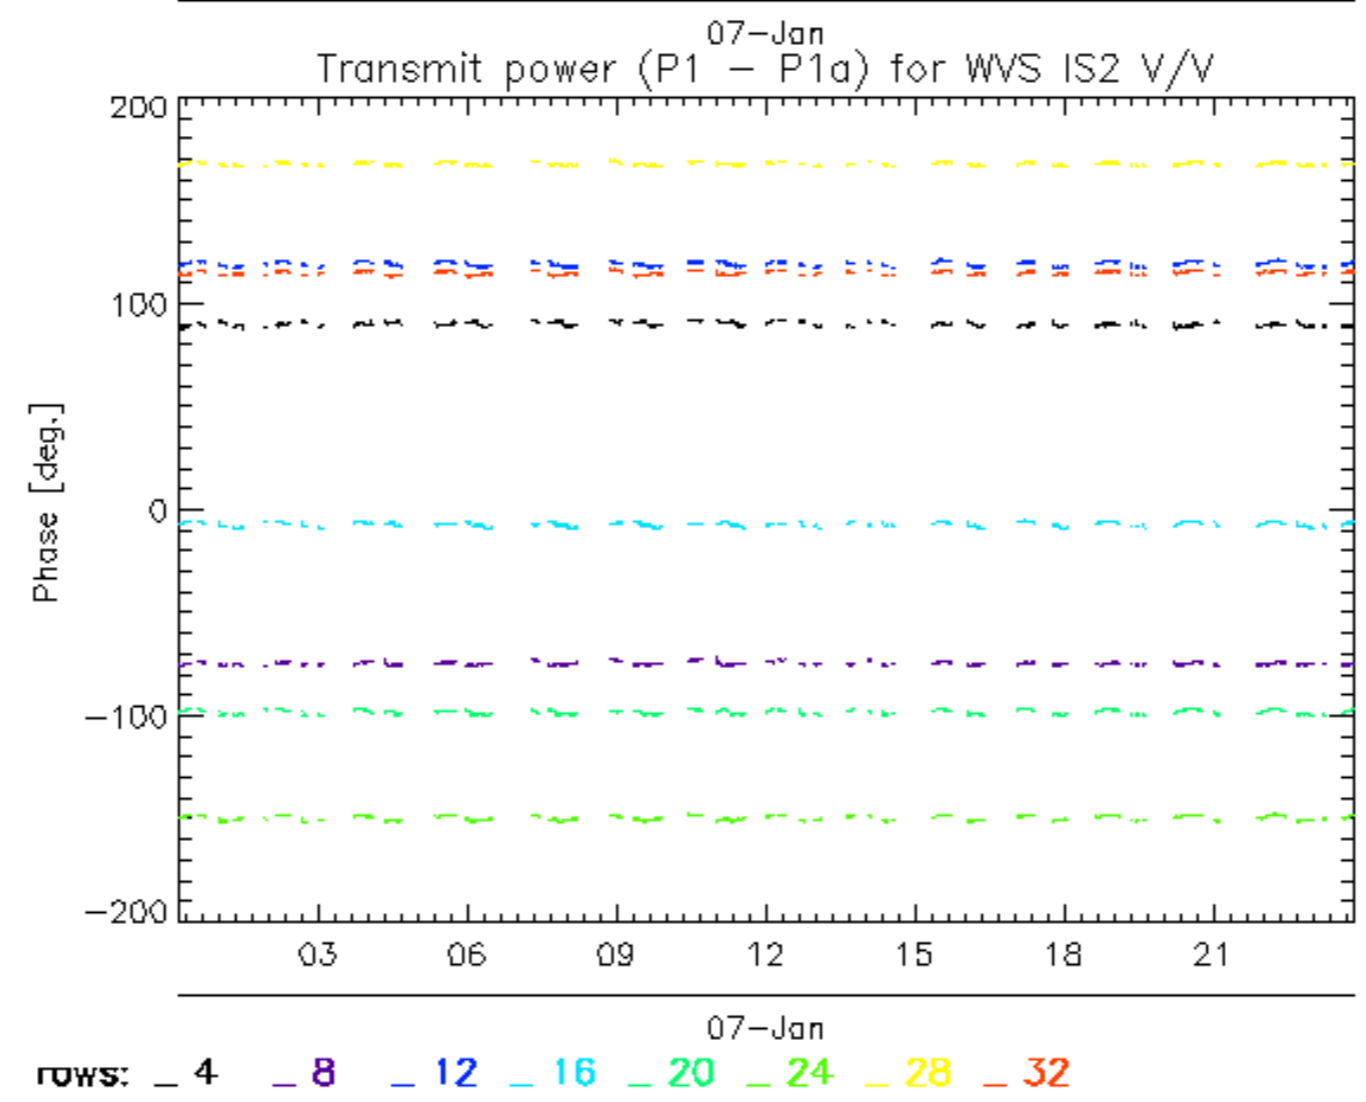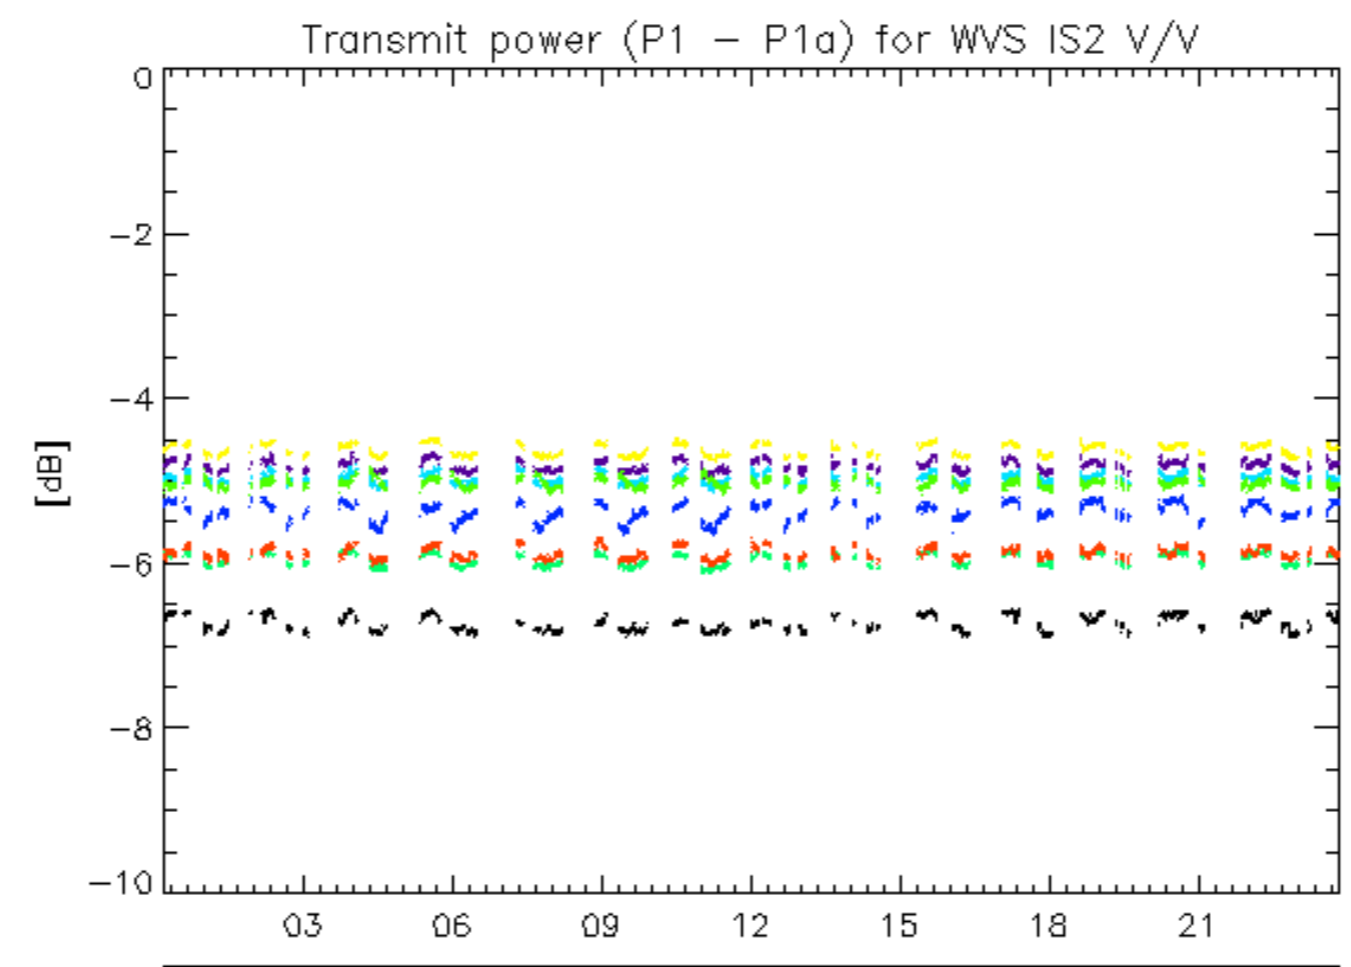

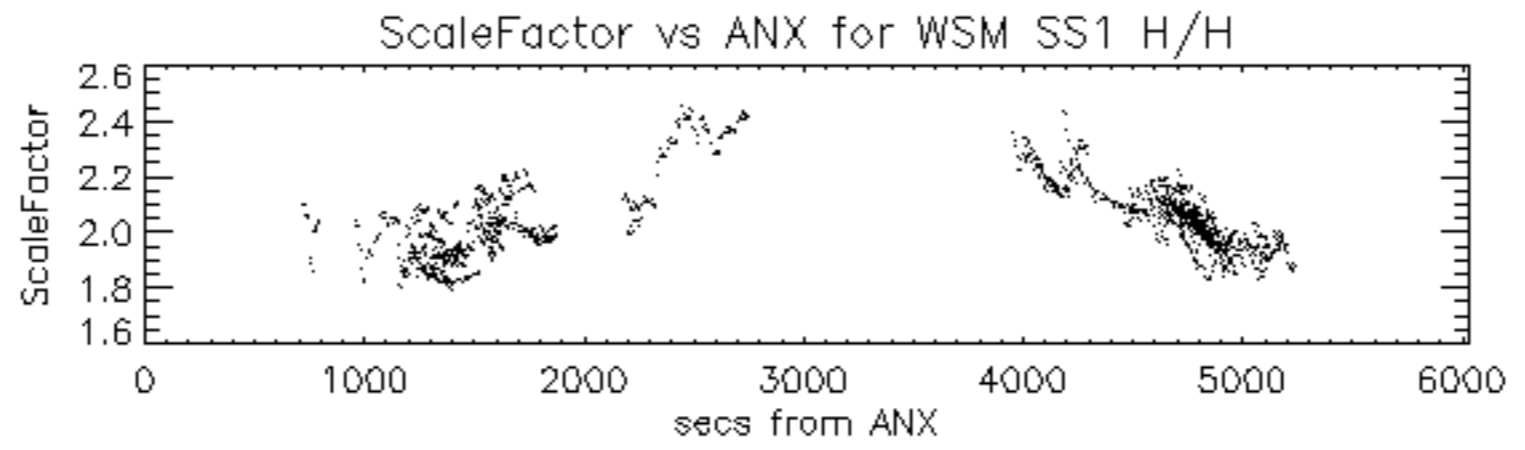

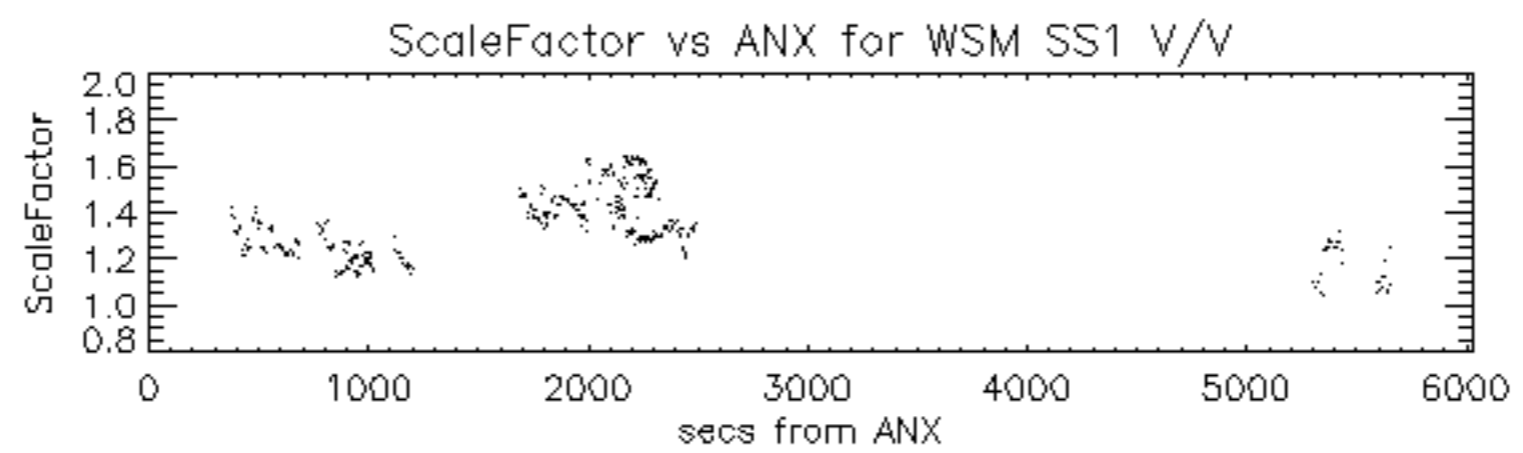

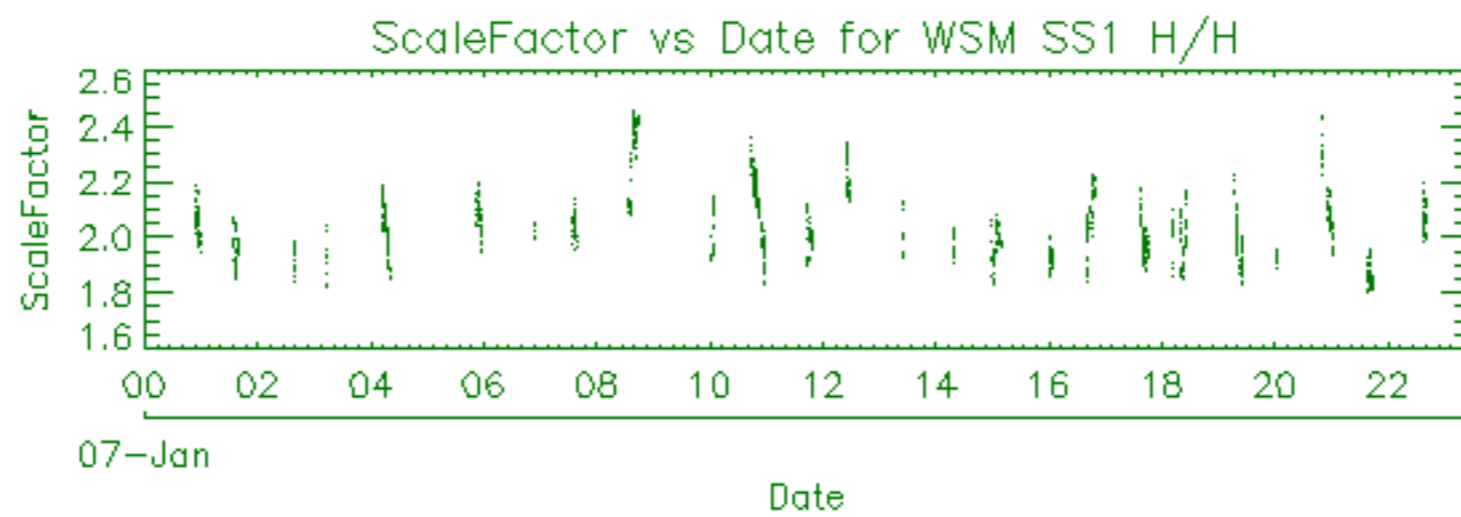

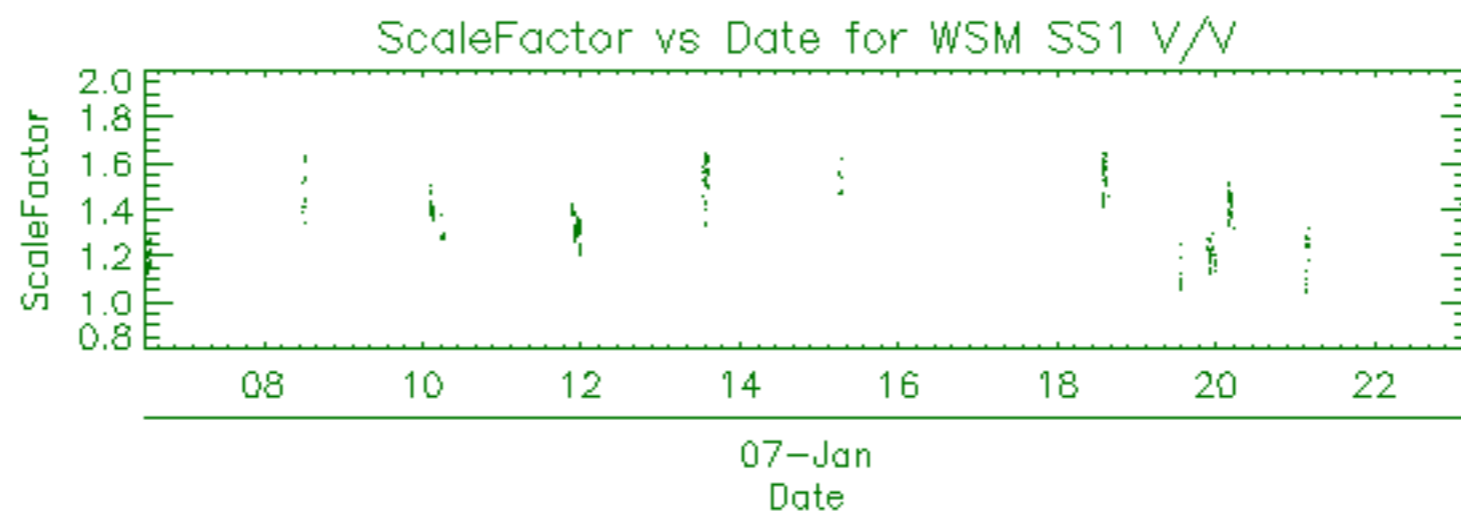

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_APM_1PNPDE20110107_065850_000000593098_00164_46299_0252.N1						IS1	H/H	98	46299	164	5.04
ASA_APM_1PNPDE20110107_070742_000001233098_00164_46299_0253.N1						IS4	V/V	98	46299	164	5.04
ASA_APM_1PNPDK20110107_084549_000001133098_00165_46300_5284.N1						IS4	V/V	98	46300	165	5.04
ASA_APM_1PNPDE20110107_134613_000000423098_00168_46303_0341.N1						IS4	V/H	98	46303	168	5.04

ASA_GM1_1PNPDE20110107_222807_000005193098_00173_46308_0385.N1	SS1	H/H	98	46308	173	5.04
ASA_GM1_1PNPDE20110107_230109_000002773098_00174_46309_0394.N1	SS1	H/H	98	46309	174	5.04
ASA_GM1_1PNPDE20110107_232028_000000903098_00174_46309_0393.N1	SS1	H/H	98	46309	174	5.04
ASA_GM1_1PNPDE20110107_232613_000005313098_00174_46309_0397.N1	SS1	H/H	98	46309	174	5.04
ASA_GM1_1PNPDE20110107_235916_000000783098_00174_46309_0401.N1	SS1	H/H	98	46309	174	5.04


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20110107_025419_000000383098_00161_46296_0200.N1						IS7	V/V	98	46296	161	5.04
ASA_IMM_1PNPDE20110107_033335_000002433098_00162_46297_0196.N1						IS6	H/H	98	46297	162	5.04
ASA_IMM_1PNPDE20110107_051308_000004003098_00163_46298_0233.N1						IS6	H/H	98	46298	163	5.04
ASA_IMM_1PNPDK20110107_115014_000001223098_00167_46302_5294.N1						IS6	H/H	98	46302	167	5.04
ASA_IMM_1PNPDK20110107_124759_000000383098_00167_46302_5307.N1						IS6	H/H	98	46302	167	5.04
ASA_IMM_1PNPDK20110107_130704_000000623098_00168_46303_5313.N1						IS6	H/H	98	46303	168	5.04


Filename	Pol	Timestamp	count(Module)				
ASA_MS__0PNPDK20110107_154540_000000163098_00169_46304_0384.N1	H	2011-01-07 15:45:40	320				
ASA_MS__0PNPDK20110107_172554_000000163098_00170_46305_0385.N1	V	2011-01-07 17:25:54	320				





Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WSM_1PNPDE20110106_235830_000001533098_00160_46295_0175.N1						SS1	H/H	98	46295	160	5.04
ASA_WSM_1PNPDE20110107_005345_000003303098_00160_46295_0177.N1						SS1	H/H	98	46295	160	5.04
ASA_WSM_1PNPDE20110107_013348_000003493098_00161_46296_0197.N1						SS1	H/H	98	46296	161	5.04
ASA_WSM_1PNPDE20110107_023724_000001533098_00161_46296_0199.N1						SS1	H/H	98	46296	161	5.04
ASA_WSM_1PNPDE20110107_031243_000000923098_00162_46297_0219.N1						SS1	H/H	98	46297	162	5.04
ASA_WSM_1PNPDE20110107_041107_000005323098_00162_46297_0232.N1						SS1	H/H	98	46297	162	5.04
ASA_WSM_1PNPDE20110107_055151_000003923098_00163_46298_0257.N1						SS1	H/H	98	46298	163	5.04
ASA_WSM_1PNPDE20110107_063005_000002693098_00164_46299_0272.N1						SS1	V/V	98	46299	164	5.04
ASA_WSM_1PNPDE20110107_065353_000000923098_00164_46299_0251.N1						SS1	H/H	98	46299	164	5.04
ASA_WSM_1PNPDK20110107_073410_000002693098_00164_46299_5305.N1						SS1	H/H	98	46299	164	5.04
ASA_WSM_1PNPDK20110107_082952_000000923098_00165_46300_5253.N1						SS1	V/V	98	46300	165	5.04
ASA_WSM_1PNPDE20110107_083348_000005933098_00165_46300_0294.N1						SS1	H/H	98	46300	165	5.04
ASA_WSM_1PNPDE20110107_100141_000002143098_00166_46301_0307.N1						SS1	H/H	98	46301	166	5.04
ASA_WSM_1PNPDK20110107_100551_000001533098_00166_46301_5259.N1						SS1	V/V	98	46301	166	5.04
ASA_WSM_1PNPDE20110107_101450_000000923098_00166_46301_0308.N1						SS1	V/V	98	46301	166	5.04
ASA_WSM_1PNPDE20110107_104340_000005753098_00166_46301_0318.N1						SS1	H/H	98	46301	166	5.04
ASA_WSM_1PNPDE20110107_105423_000002693098_00166_46301_0326.N1						SS1	H/H	98	46301	166	5.04
ASA_WSM_1PNPDK20110107_114312_000003733098_00167_46302_5293.N1						SS1	H/H	98	46302	167	5.04
ASA_WSM_1PNPDE20110107_115322_000003923098_00167_46302_0327.N1						SS1	V/V	98	46302	167	5.04
ASA_WSM_1PNPDE20110107_122439_000002453098_00167_46302_0328.N1						SS1	H/H	98	46302	167	5.04
ASA_WSM_1PNPDK20110107_132431_000001163098_00168_46303_5317.N1						SS1	H/H	98	46303	168	5.04
ASA_WSM_1PNPDE20110107_133217_000002693098_00168_46303_0340.N1						SS1	V/V	98	46303	168	5.04
ASA_WSM_1PNPDE20110107_141744_000001533098_00168_46303_0342.N1						SS1	H/H	98	46303	168	5.04
ASA_WSM_1PNPDK20110107_145902_000002083098_00169_46304_5363.N1						SS1	H/H	98	46304	169	5.04
ASA_WSM_1PNPDK20110107_150340_000001353098_00169_46304_5362.N1						SS1	H/H	98	46304	169	5.04
ASA_WSM_1PNPDE20110107_150715_000001593098_00169_46304_0343.N1						SS1	H/H	98	46304	169	5.04
ASA_WSM_1PNPDE20110107_151519_000000923098_00169_46304_0344.N1						SS1	V/V	98	46304	169	5.04
ASA_WSM_1PNPDE20110107_155955_000002323098_00169_46304_0339.N1						SS1	H/H	98	46304	169	5.04
ASA_WSM_1PNPDK20110107_163917_000002083098_00170_46305_5405.N1						SS1	H/H	98	46305	170	5.04
ASA_WSM_1PNPDE20110107_164442_000002323098_00170_46305_0347.N1						SS1	H/H	98	46305	170	5.04
ASA_WSM_1PNPDE20110107_173701_000002513098_00170_46305_0345.N1						SS1	H/H	98	46305	170	5.04
ASA_WSM_1PNPDE20110107_174141_000002513098_00170_46305_0346.N1						SS1	H/H	98	46305	170	5.04
ASA_WSM_1PNPDE20110107_181054_000000923098_00171_46306_0348.N1						SS1	H/H	98	46306	171	5.04
ASA_WSM_1PNPDK20110107_181843_000002693098_00171_46306_5444.N1						SS1	H/H	98	46306	171	5.04
ASA_WSM_1PNPDE20110107_182404_000001533098_00171_46306_0349.N1						SS1	H/H	98	46306	171	5.04
ASA_WSM_1PNPDE20110107_183345_000002513098_00171_46306_0352.N1						SS1	V/V	98	46306	171	5.04
ASA_WSM_1PNPDE20110107_191724_000001903098_00171_46306_0350.N1						SS1	H/H	98	46306	171	5.04
ASA_WSM_1PNPDE20110107_192257_000002143098_00171_46306_0351.N1						SS1	H/H	98	46306	171	5.04
ASA_WSM_1PNPDE20110107_193204_000000923098_00171_46306_0353.N1						SS1	V/V	98	46306	171	5.04
ASA_WSM_1PNPDK20110107_195352_000001533098_00172_46307_5466.N1						SS1	V/V	98	46307	172	5.04
ASA_WSM_1PNPDK20110107_195743_000001043098_00172_46307_5470.N1						SS1	V/V	98	46307	172	5.04
ASA_WSM_1PNPDK20110107_200026_000001773098_00172_46307_5473.N1						SS1	H/H	98	46307	172	5.04
ASA_WSM_1PNPDE20110107_200850_000002393098_00172_46307_0370.N1						SS1	V/V	98	46307	172	5.04
ASA_WSM_1PNPDE20110107_204852_000001283098_00172_46307_0368.N1						SS1	H/H	98	46307	172	5.04
ASA_WSM_1PNPDE20110107_205530_000003553098_00172_46307_0367.N1						SS1	H/H	98	46307	172	5.04
ASA_WSM_1PNPDE20110107_210730_000001533098_00172_46307_0369.N1						SS1	V/V	98	46307	172	5.04
ASA_WSM_1PNPDE20110107_213835_000003923098_00173_46308_0375.N1						SS1	H/H	98	46308	173	5.04
ASA_WSM_1PNPDE20110107_213835_000003923098_00173_46308_0378.N1						SS1	H/H	98	46308	173	5.04
ASA_WSM_1PNPDK20110107_213846_000002513098_00173_46308_5479.N1						SS1	H/H	98	46308	173	5.04
ASA_WSM_1PNPDE20110107_223650_000002513098_00173_46308_0372.N1						SS1	H/H	98	46308	173	5.04
ASA_WSM_1PNPDE20110107_230552_000003303098_00174_46309_0390.N1						SS1	V/V	98	46309	174	5.04
ASA_WSM_1PNPDE20110107_232206_000002453098_00174_46309_0391.N1						SS1	H/H	98	46309	174	5.04




Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20110107_001143_000008993098_00160_46295_0182.N1						IS2	V/V	98	46295	160	5.04
ASA_WVS_1PNPDE20110107_003551_000005103098_00160_46295_0184.N1						IS2	V/V	98	46295	160	5.04
ASA_WVS_1PNPDE20110107_005917_000003593098_00160_46295_0185.N1						IS2	V/V	98	46295	160	5.04
ASA_WVS_1PNPDE20110107_010432_000003003098_00160_46295_0198.N1						IS2	V/V	98	46295	160	5.04
ASA_WVS_1PNPDE20110107_005917_000003593098_00160_46295_0185.N1						IS1	V/V	98	46295	160	5.04
ASA_WVS_1PNPDE20110107_011622_000008243098_00160_46295_0209.N1						IS2	V/V	98	46295	160	5.04
ASA_WVS_1PNPDE20110107_015555_000000743098_00161_46296_0208.N1						IS2	V/V	98	46296	161	5.04
ASA_WVS_1PNPDE20110107_020927_000009153098_00161_46296_0207.N1						IS2	V/V	98	46296	161	5.04
ASA_WVS_1PNPDE20110107_023957_000003003098_00161_46296_0203.N1						IS2	V/V	98	46296	161	5.04
ASA_WVS_1PNPDE20110107_030003_000003143098_00162_46297_0220.N1						IS2	V/V	98	46297	162	5.04
ASA_WVS_1PNPDE20110107_034244_000007793098_00162_46297_0221.N1						IS2	V/V	98	46297	162	5.04
ASA_WVS_1PNPDE20110107_035514_000002553098_00162_46297_0234.N1						IS2	V/V	98	46297	162	5.04
ASA_WVS_1PNPDE20110107_034244_000007793098_00162_46297_0221.N1						IS1	V/V	98	46297	162	5.04
ASA_WVS_1PNPDE20110107_040327_000000903098_00162_46297_0235.N1						IS2	V/V	98	46297	162	5.04
ASA_WVS_1PNPDE20110107_042000_000012293098_00162_46297_0237.N1						IS2	V/V	98	46297	162	5.04
ASA_WVS_1PNPDE20110107_052145_000010043098_00163_46298_0239.N1						IS2	V/V	98	46298	163	5.04
ASA_WVS_1PNPDE20110107_053814_000004053098_00163_46298_0254.N1						IS2	V/V	98	46298	163	5.04
ASA_WVS_1PNPDE20110107_052145_000010043098_00163_46298_0239.N1						IS1	V/V	98	46298	163	5.04
ASA_WVS_1PNPDE20110107_055840_000018443098_00163_46298_0268.N1						IS2	V/V	98	46298	163	5.04
ASA_WVS_1PNPDE20110107_071636_000001803098_00164_46299_0267.N1						IS2	V/V	98	46299	164	5.04
ASA_WVS_1PNPDK20110107_071921_000003603098_00164_46299_5199.N1						IS2	V/V	98	46299	164	5.04
ASA_WVS_1PNPDK20110107_073854_000020393098_00164_46299_5265.N1						IS2	V/V	98	46299	164	5.04
ASA_WVS_1PNPDK20110107_085250_000007653098_00165_46300_5257.N1						IS2	V/V	98	46300	165	5.04
ASA_WVS_1PNPDK20110107_091917_000020993098_00165_46300_5260.N1						IS2	V/V	98	46300	165	5.04
ASA_WVS_1PNPDK20110107_102652_000009593098_00166_46301_5277.N1						IS2	V/V	98	46301	166	5.04
ASA_WVS_1PNPDK20110107_105922_000020693098_00166_46301_5282.N1						IS2	V/V	98	46301	166	5.04
ASA_WVS_1PNPDK20110107_115952_000005393098_00167_46302_5308.N1						IS2	V/V	98	46302	167	5.04
ASA_WVS_1PNPDK20110107_121506_000005253098_00167_46302_5310.N1						IS2	V/V	98	46302	167	5.04
ASA_WVS_1PNPDK20110107_123945_000004203098_00167_46302_5314.N1						IS2	V/V	98	46302	167	5.04
ASA_WVS_1PNPDK20110107_125743_000005173098_00167_46302_5315.N1						IS2	V/V	98	46302	167	5.04
ASA_WVS_1PNPDK20110107_133647_000005243098_00168_46303_5351.N1						IS2	V/V	98	46303	168	5.04
ASA_WVS_1PNPDK20110107_140317_000001803098_00168_46303_5353.N1						IS2	V/V	98	46303	168	5.04
ASA_WVS_1PNPDK20110107_142015_000004653098_00168_46303_5354.N1						IS2	V/V	98	46303	168	5.04
ASA_WVS_1PNPDK20110107_143250_000001193098_00168_46303_5358.N1						IS2	V/V	98	46303	168	5.04
ASA_WVS_1PNPDK20110107_152148_000001193098_00169_46304_5390.N1						IS2	V/V	98	46304	169	5.04
ASA_WVS_1PNPDK20110107_152613_000011243098_00169_46304_5393.N1						IS2	V/V	98	46304	169	5.04
ASA_WVS_1PNPDK20110107_160345_000011543098_00169_46304_5411.N1						IS2	V/V	98	46304	169	5.04
ASA_WVS_1PNPDK20110107_170342_000012893098_00170_46305_5432.N1						IS2	V/V	98	46305	170	5.04
ASA_WVS_1PNPDK20110107_174548_000011543098_00170_46305_5435.N1						IS2	V/V	98	46305	170	5.04
ASA_WVS_1PNPDK20110107_183754_000017393098_00171_46306_5458.N1						IS2	V/V	98	46306	171	5.04
ASA_WVS_1PNPDK20110107_192048_000000903098_00171_46306_5460.N1						IS2	V/V	98	46306	171	5.04
ASA_WVS_1PNPDK20110107_192628_000002703098_00171_46306_5461.N1						IS2	V/V	98	46306	171	5.04
ASA_WVS_1PNPDK20110107_193424_000001493098_00171_46306_5463.N1						IS2	V/V	98	46306	171	5.04
ASA_WVS_1PNPDE20110107_201246_000020693098_00172_46307_0356.N1						IS2	V/V	98	46307	172	5.04
ASA_WVS_1PNPDE20110107_210124_000000593098_00172_46307_0357.N1						IS2	V/V	98	46307	172	5.04
ASA_WVS_1PNPDE20110107_210124_000000593098_00172_46307_0360.N1						IS2	V/V	98	46307	172	5.04
ASA_WVS_1PNPDE20110107_210139_000003153098_00172_46307_0374.N1						IS2	V/V	98	46307	172	5.04
ASA_WVS_1PNPDE20110107_210124_000000593098_00172_46307_0360.N1						IS1	V/V	98	46307	172	5.04
ASA_WVS_1PNPDE20110107_210124_000000593098_00172_46307_0357.N1						IS1	V/V	98	46307	172	5.04
ASA_WVS_1PNPDE20110107_215230_000020993098_00173_46308_0377.N1						IS2	V/V	98	46308	173	5.04
ASA_WVS_1PNPDE20110107_215230_000020993098_00173_46308_0380.N1						IS2	V/V	98	46308	173	5.04
ASA_WVS_1PNPDE20110107_224101_000005553098_00173_46308_0379.N1						IS2	V/V	98	46308	173	5.04
ASA_WVS_1PNPDE20110107_224101_000005553098_00173_46308_0376.N1						IS2	V/V	98	46308	173	5.04
ASA_WVS_1PNPDE20110107_224931_000006593098_00173_46308_0395.N1						IS2	V/V	98	46308	173	5.04
ASA_WVS_1PNPDE20110107_231240_000002103098_00174_46309_0396.N1						IS2	V/V	98	46309	174	5.04
ASA_WVS_1PNPDE20110107_233509_000008843098_00174_46309_0399.N1						IS2	V/V	98	46309	174	5.04



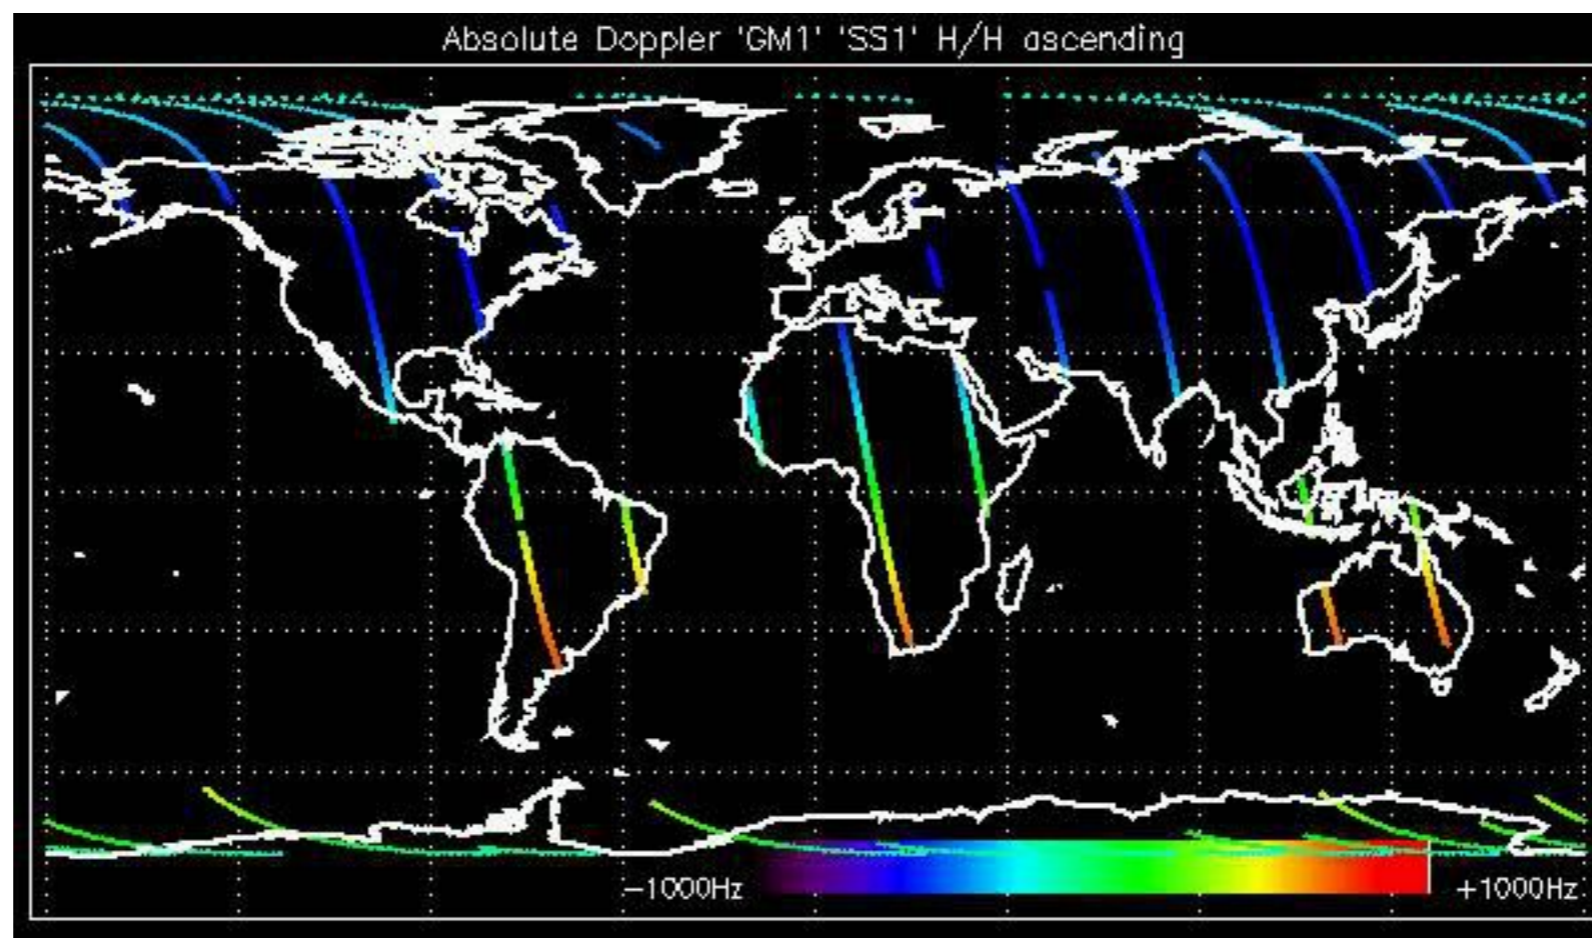


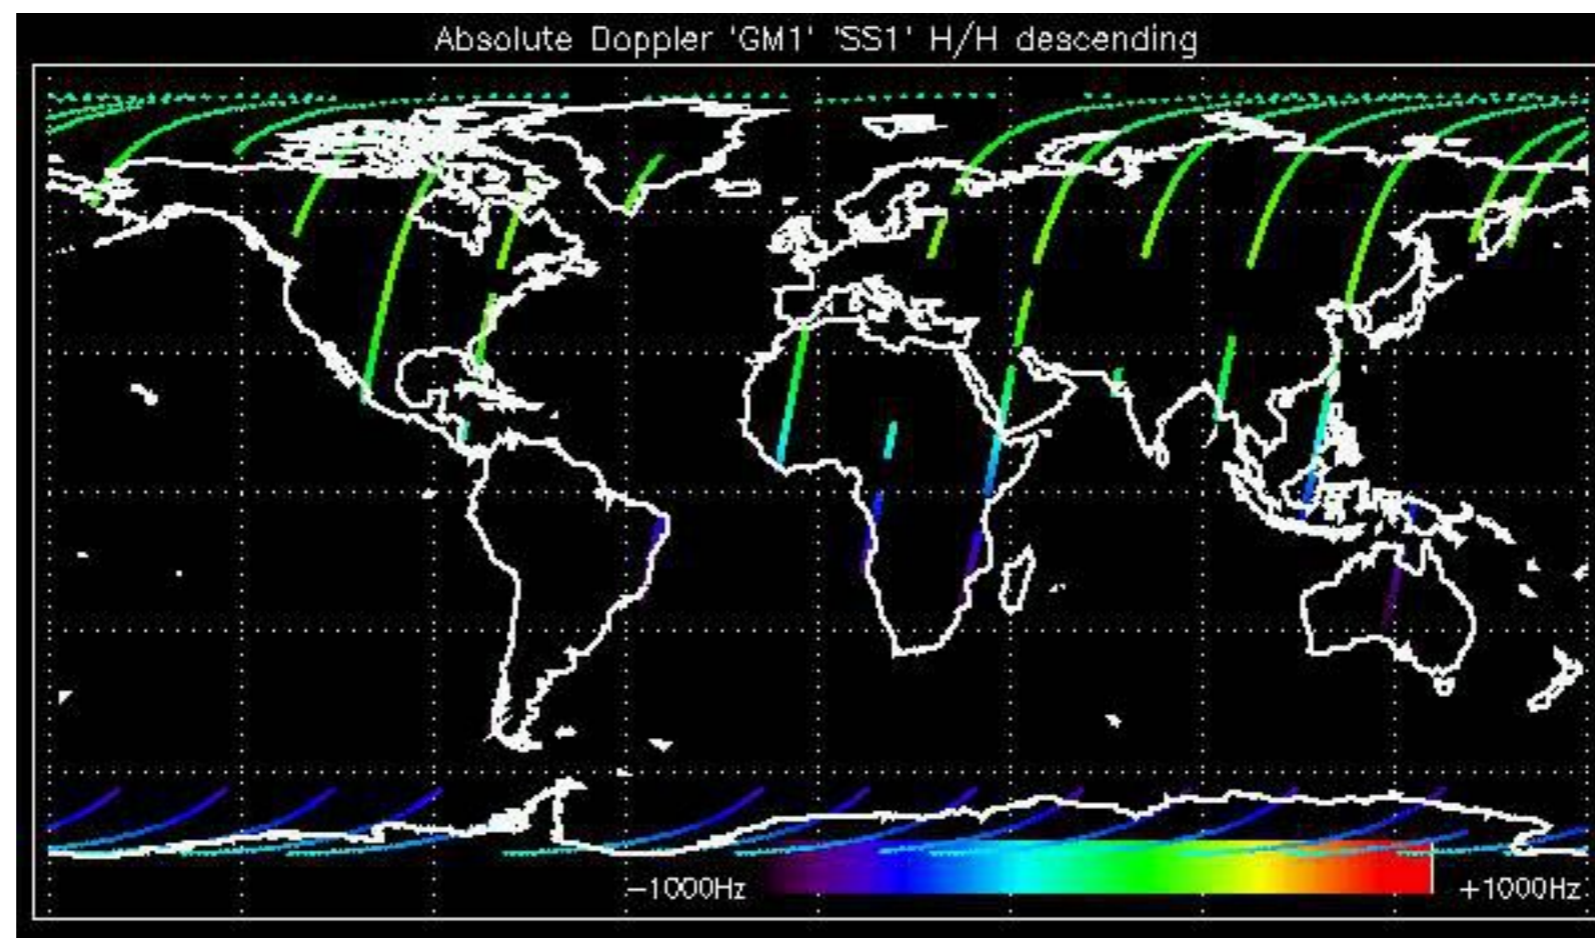


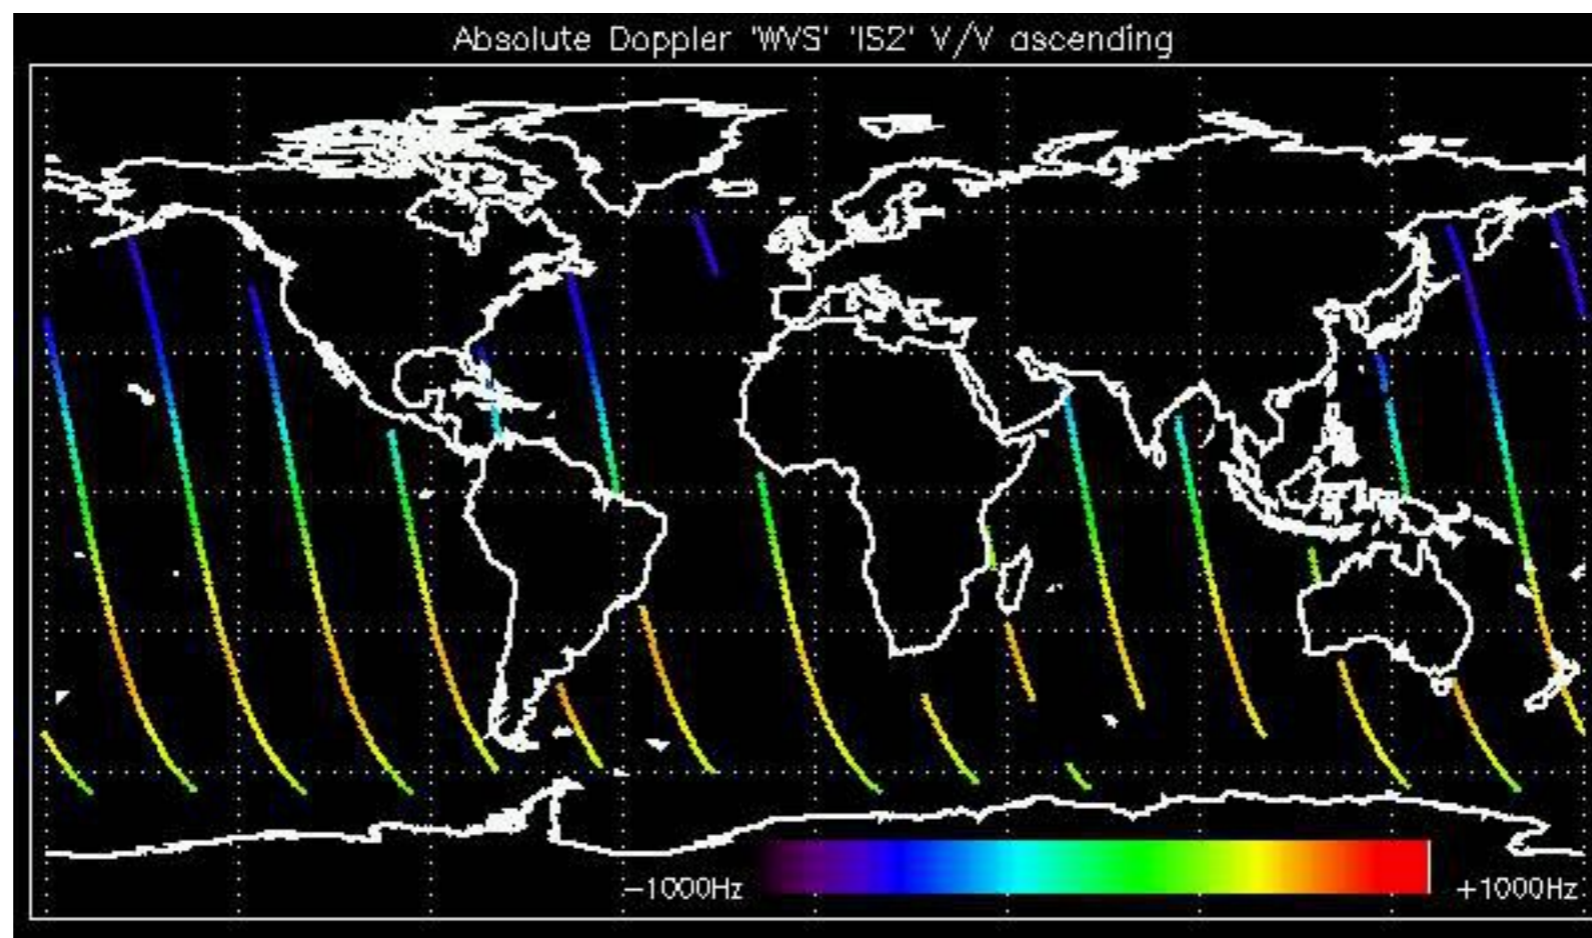


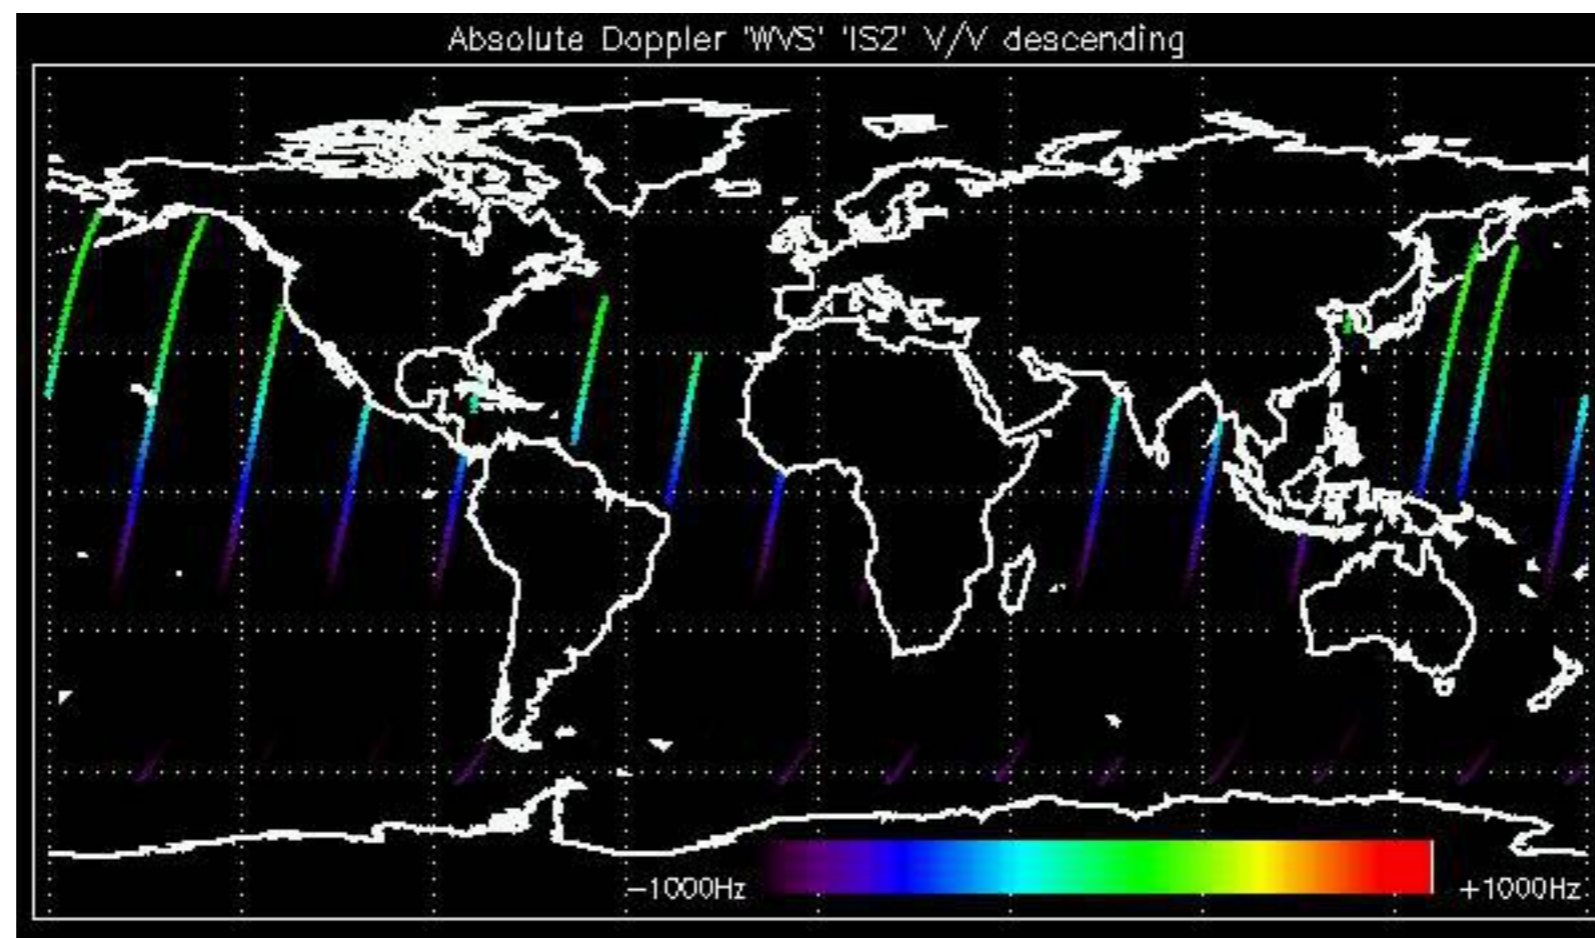


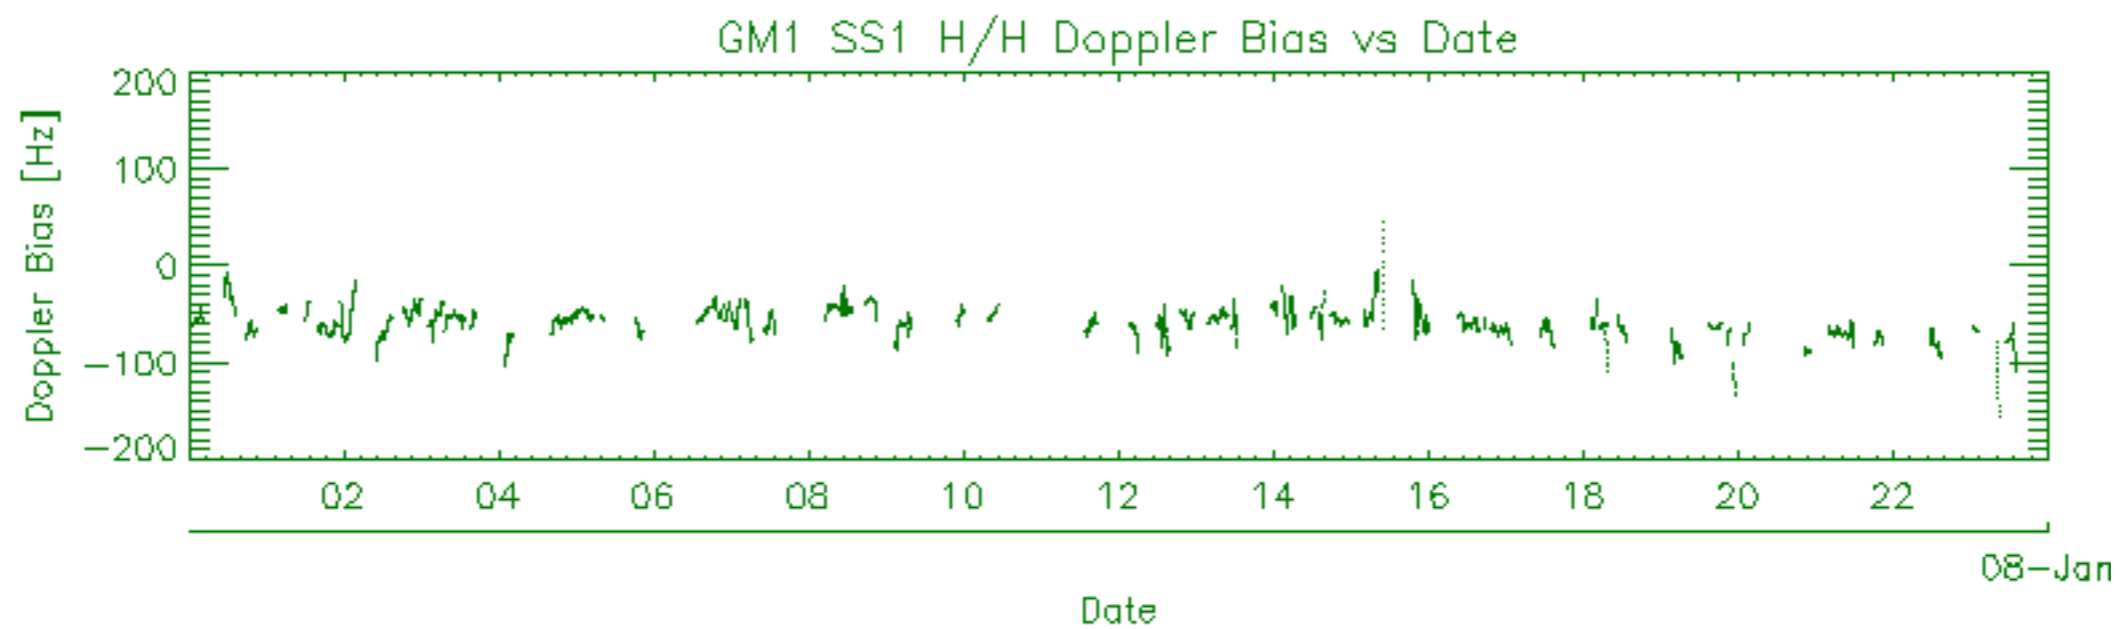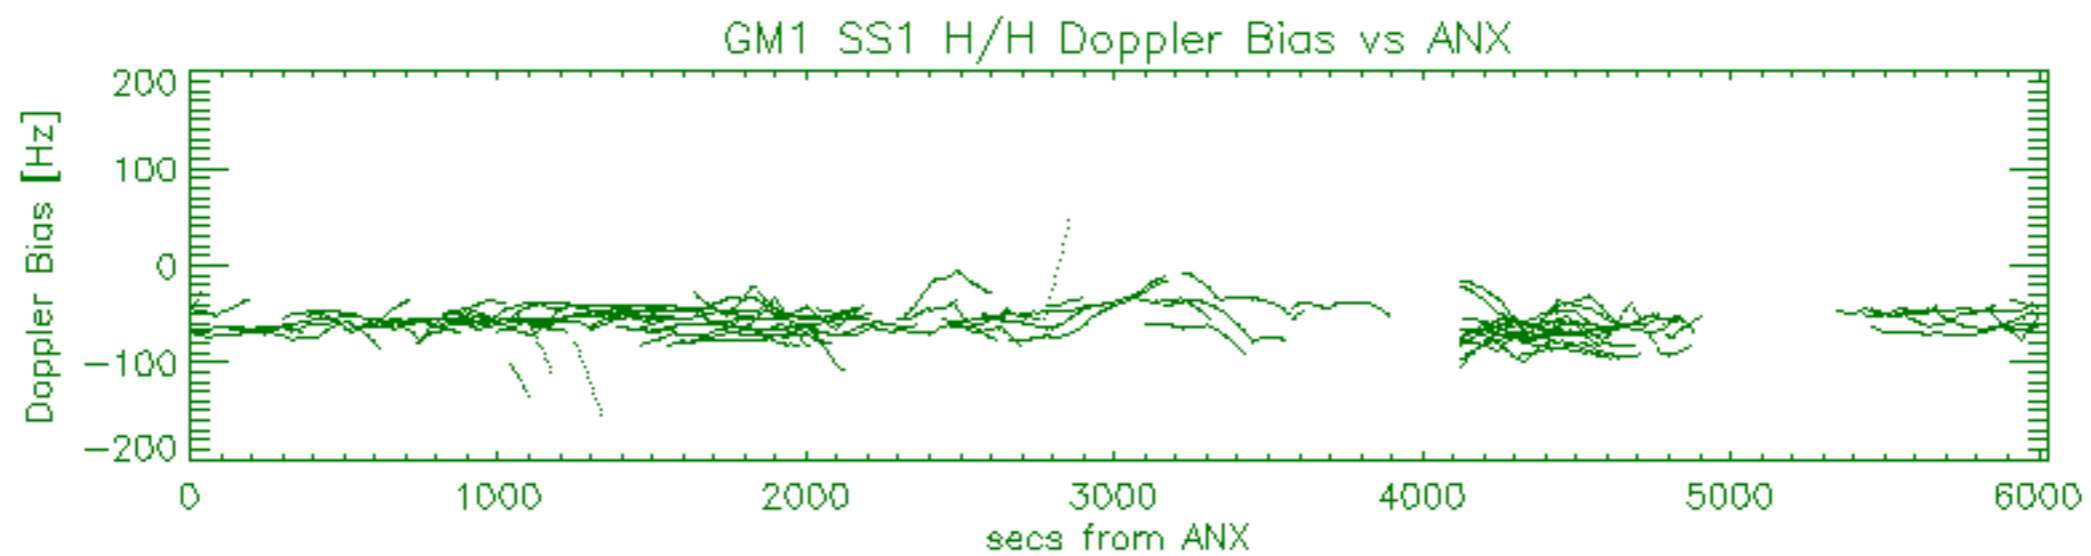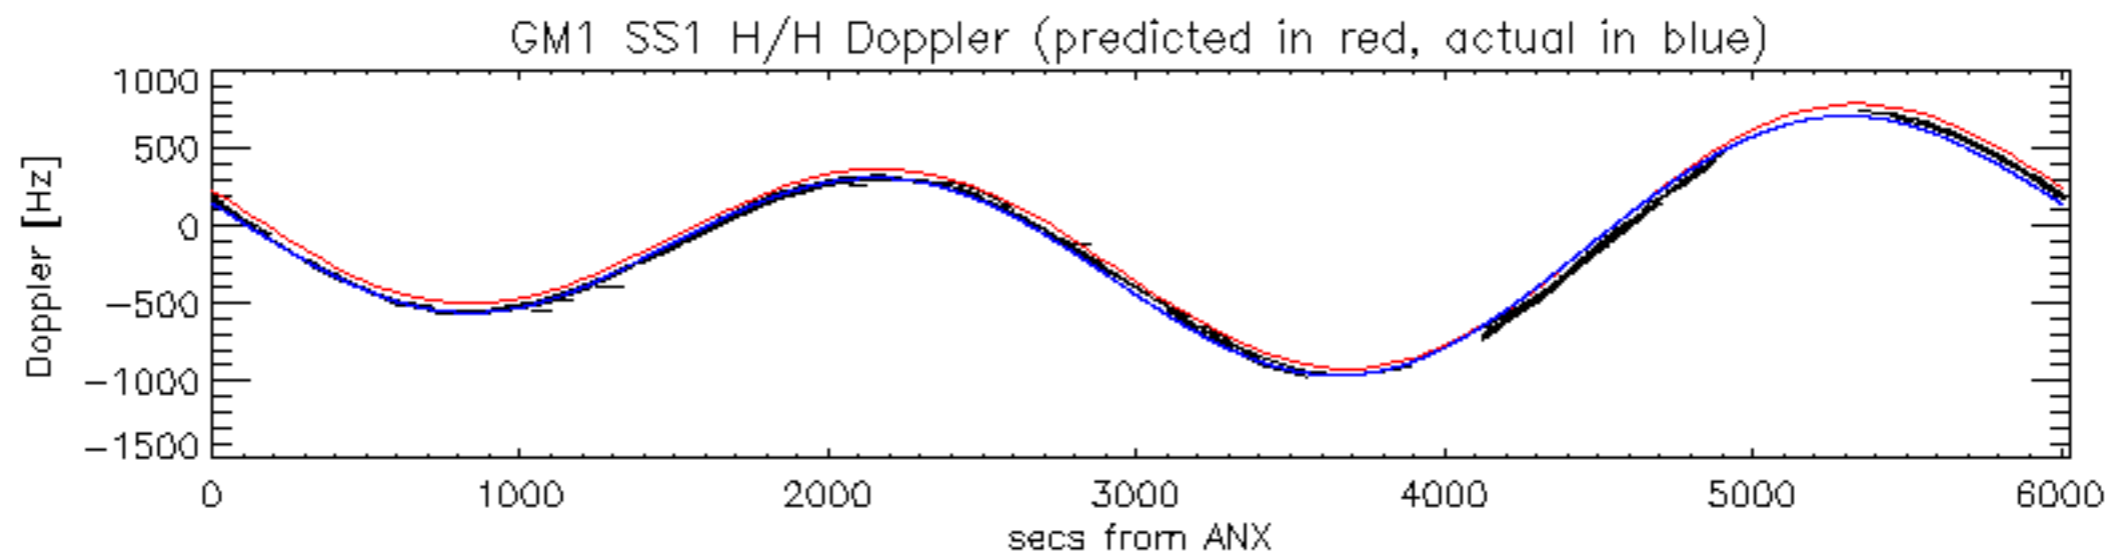



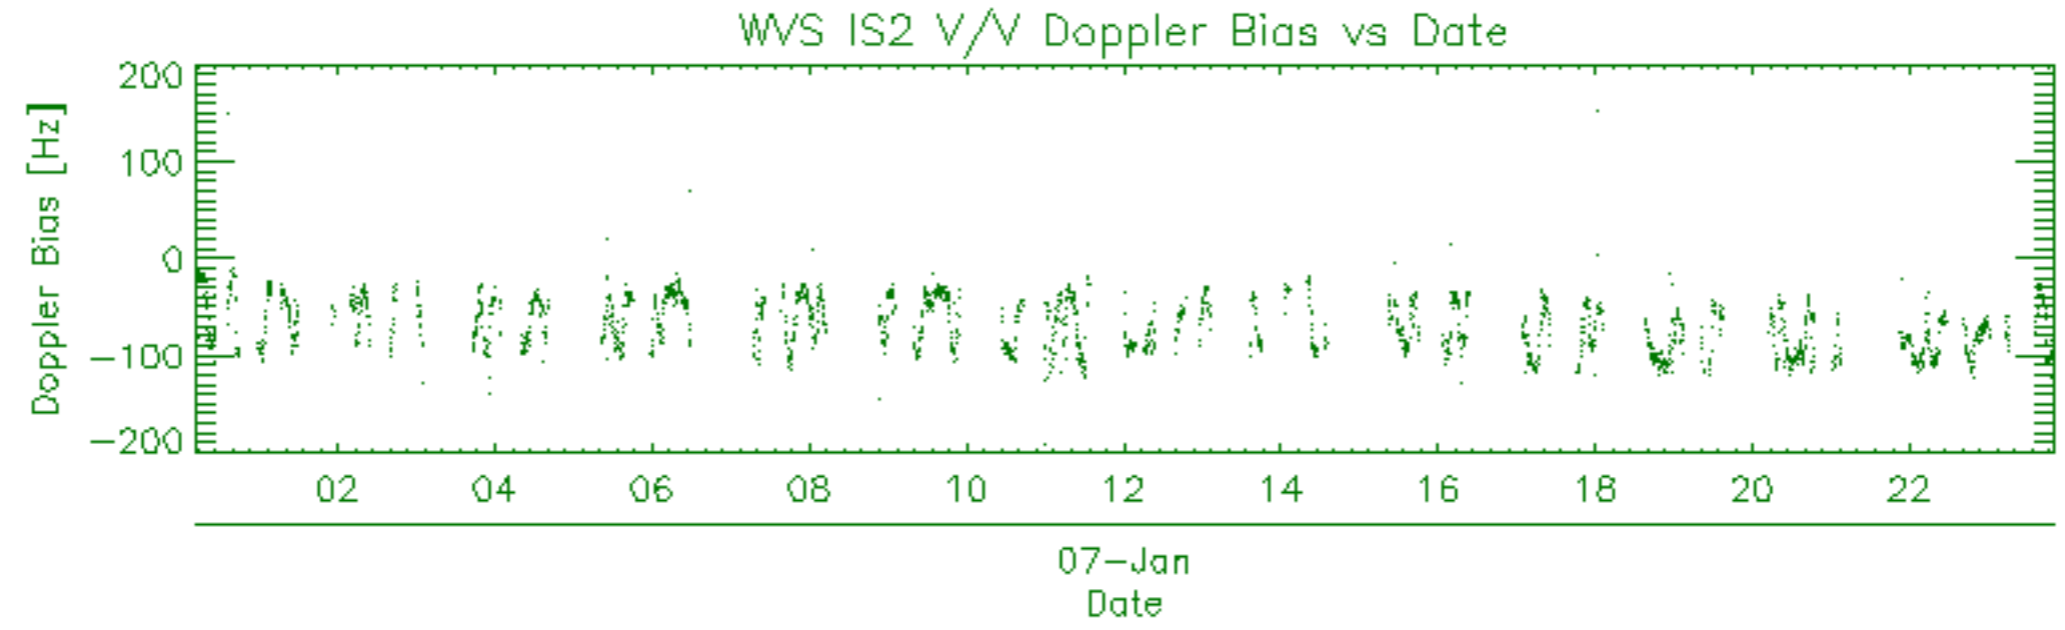
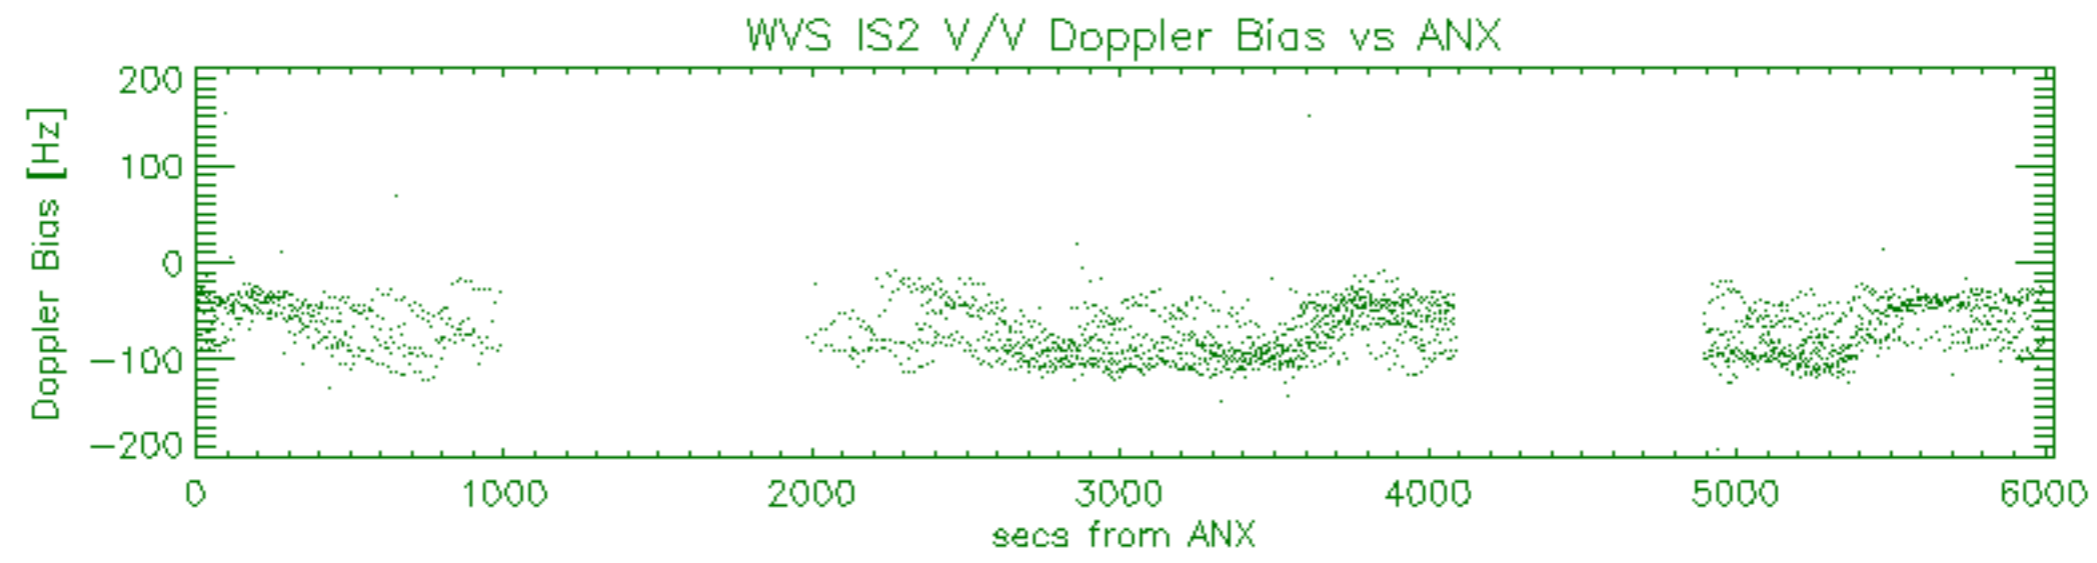
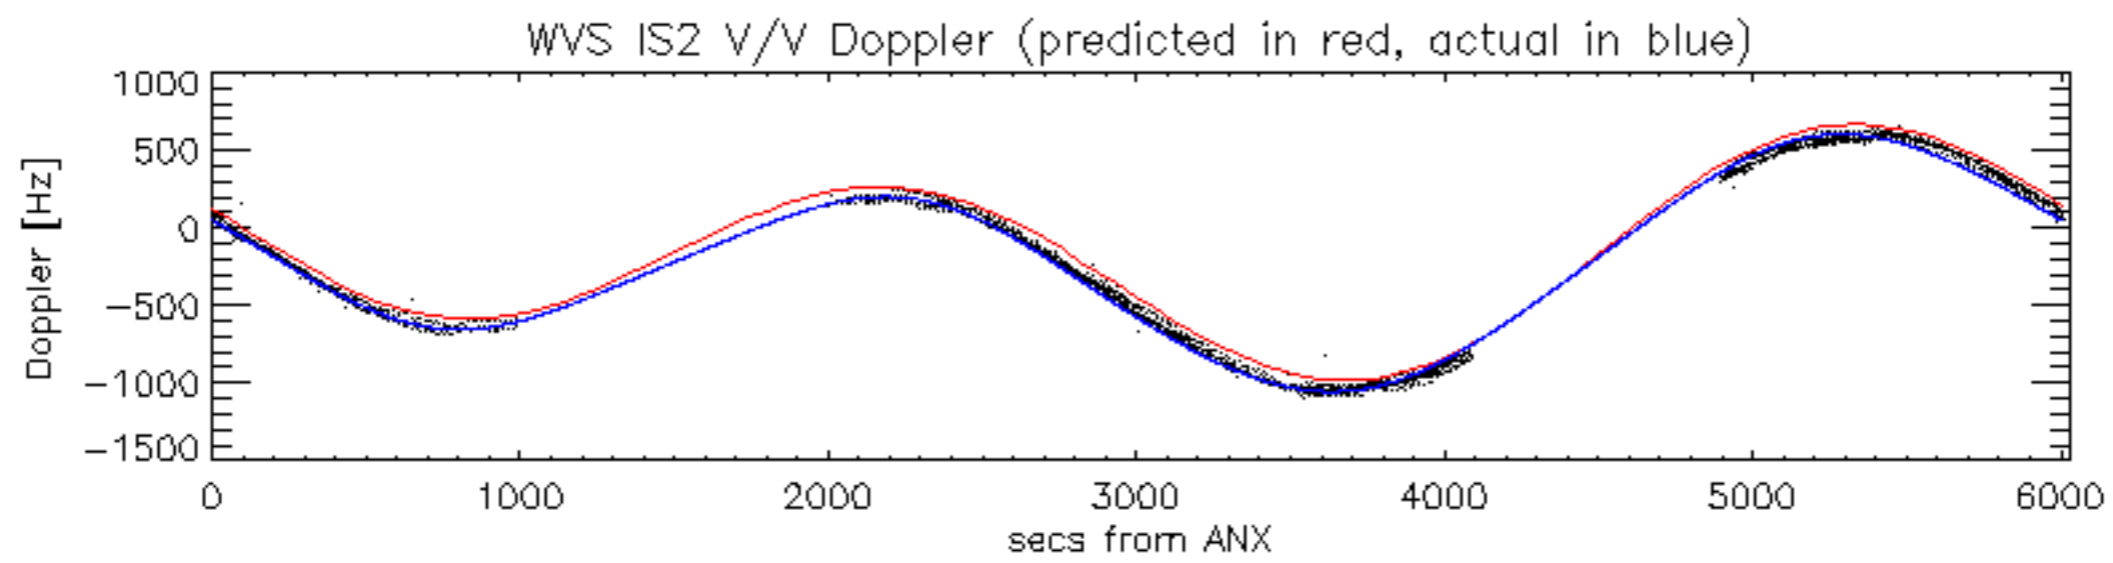


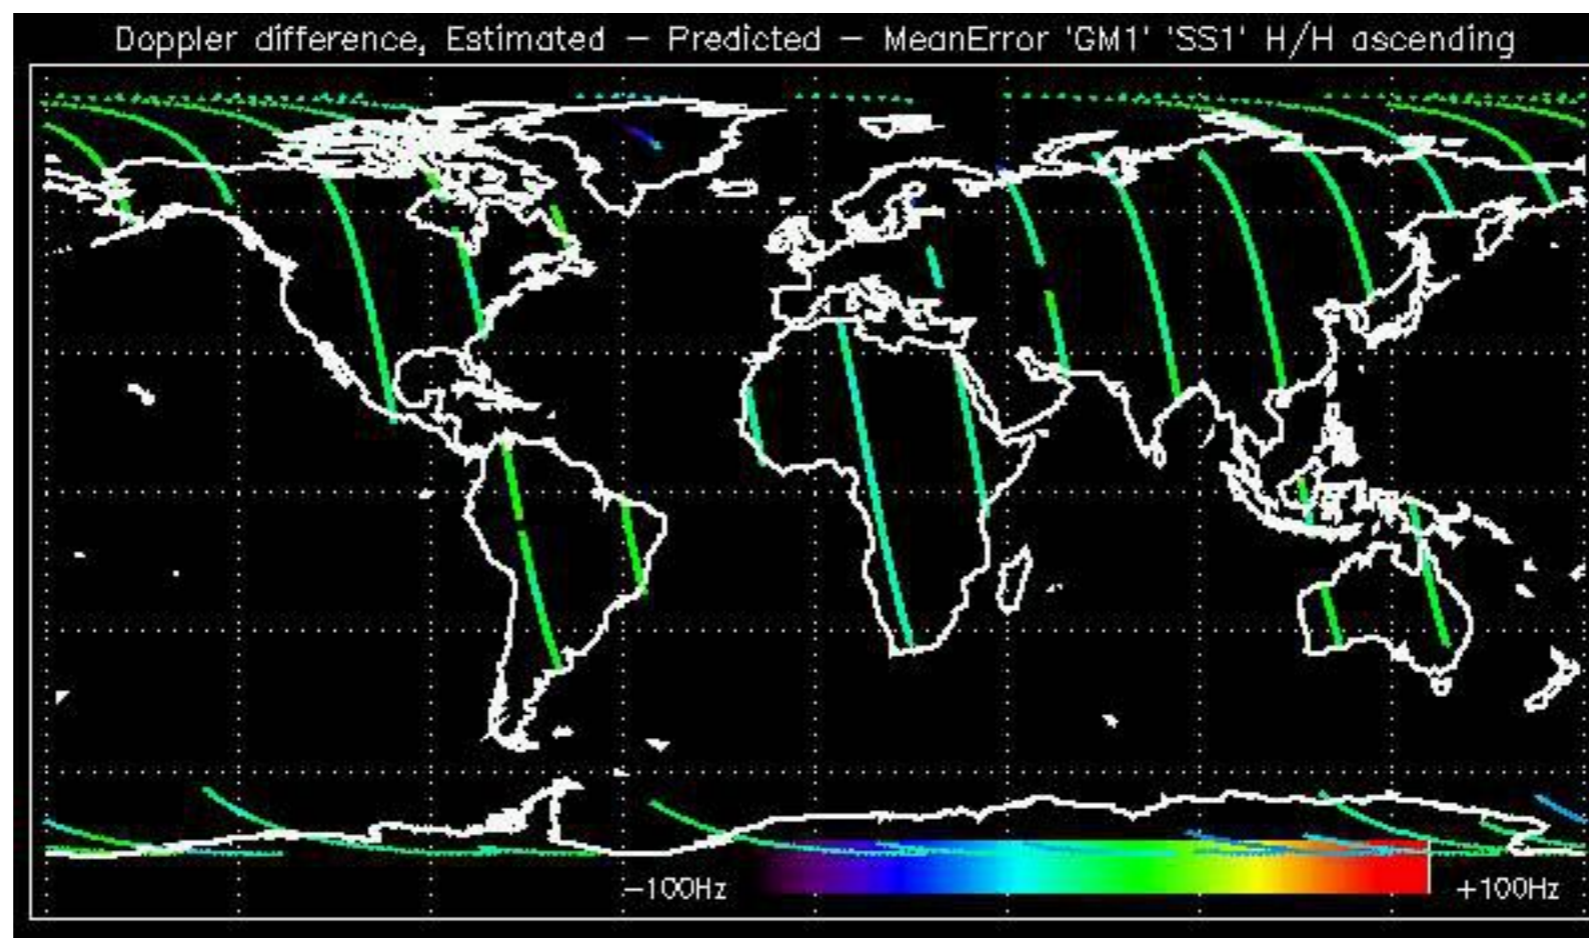


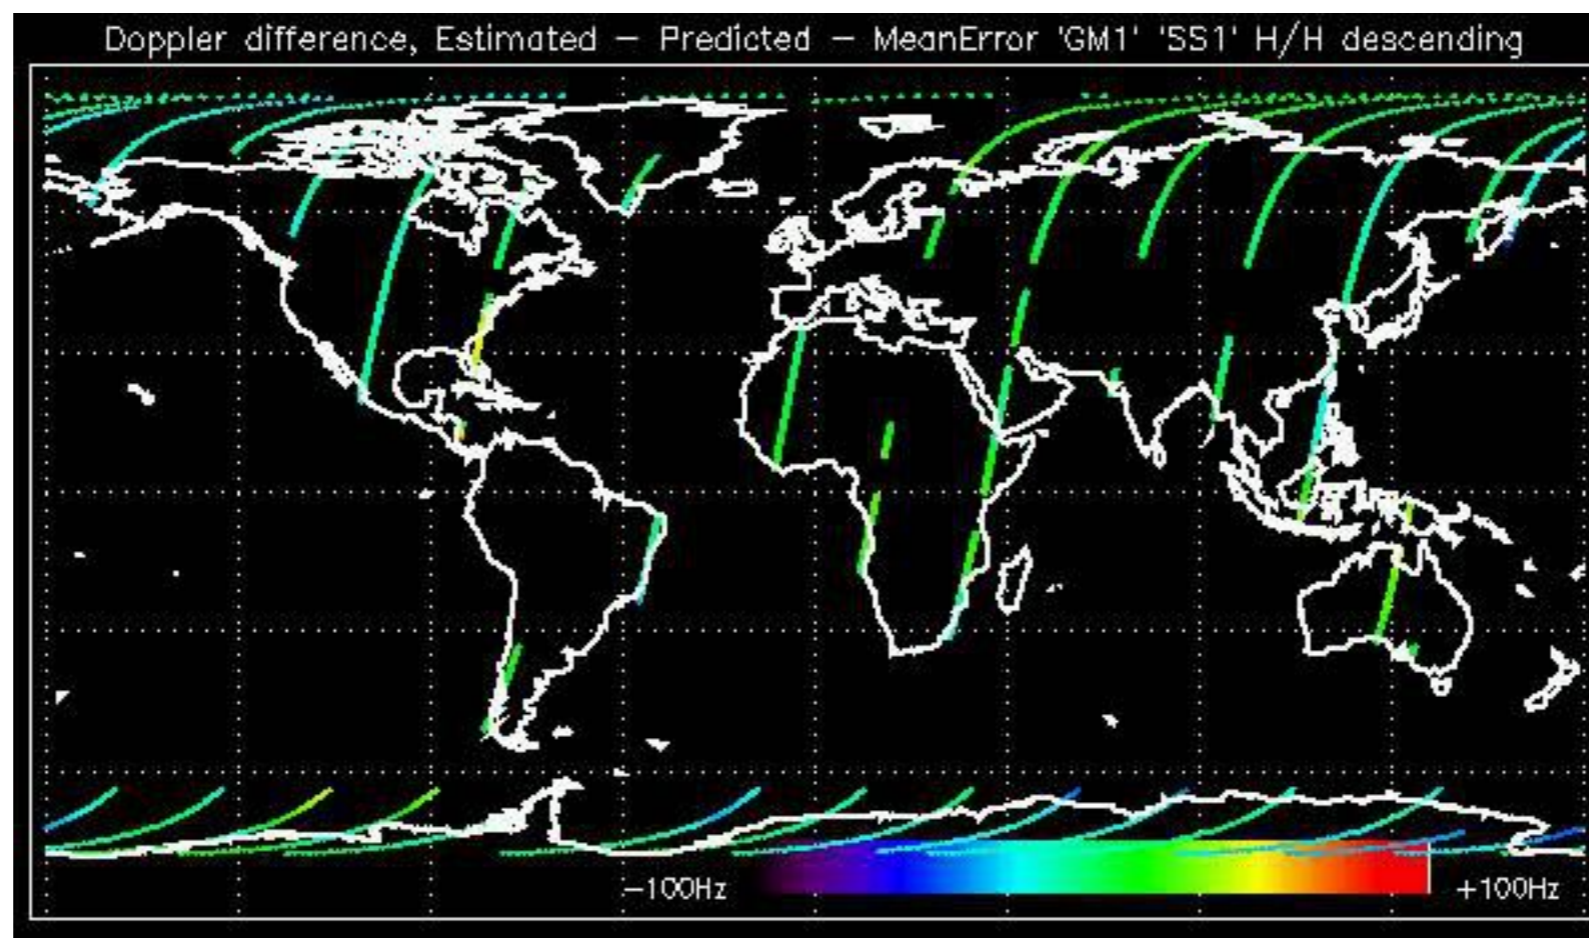


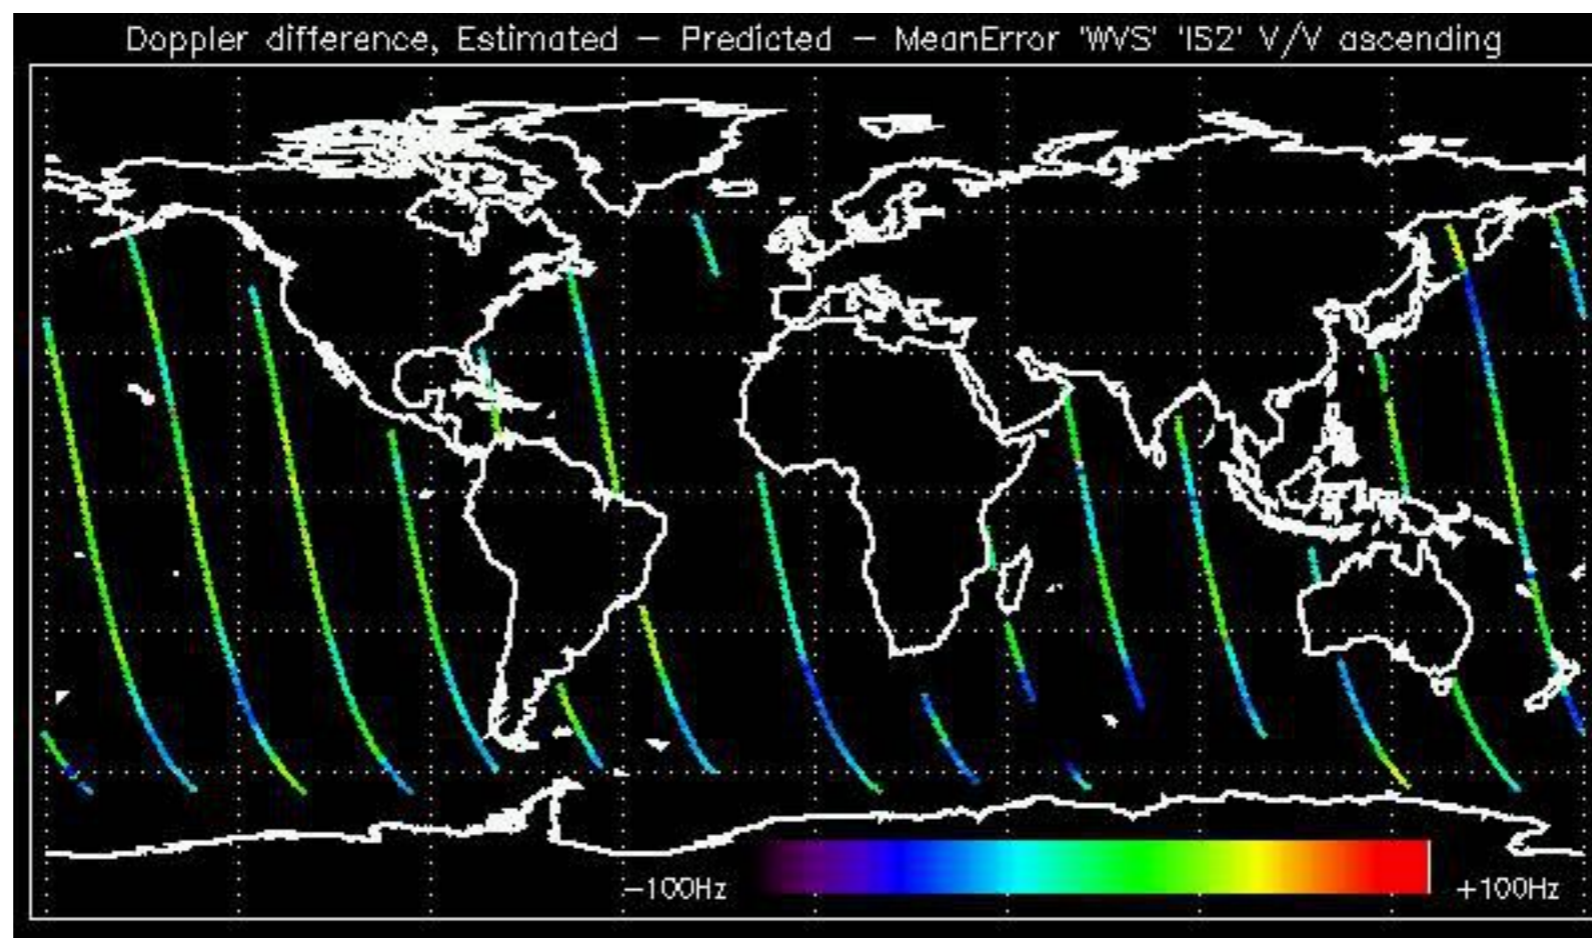


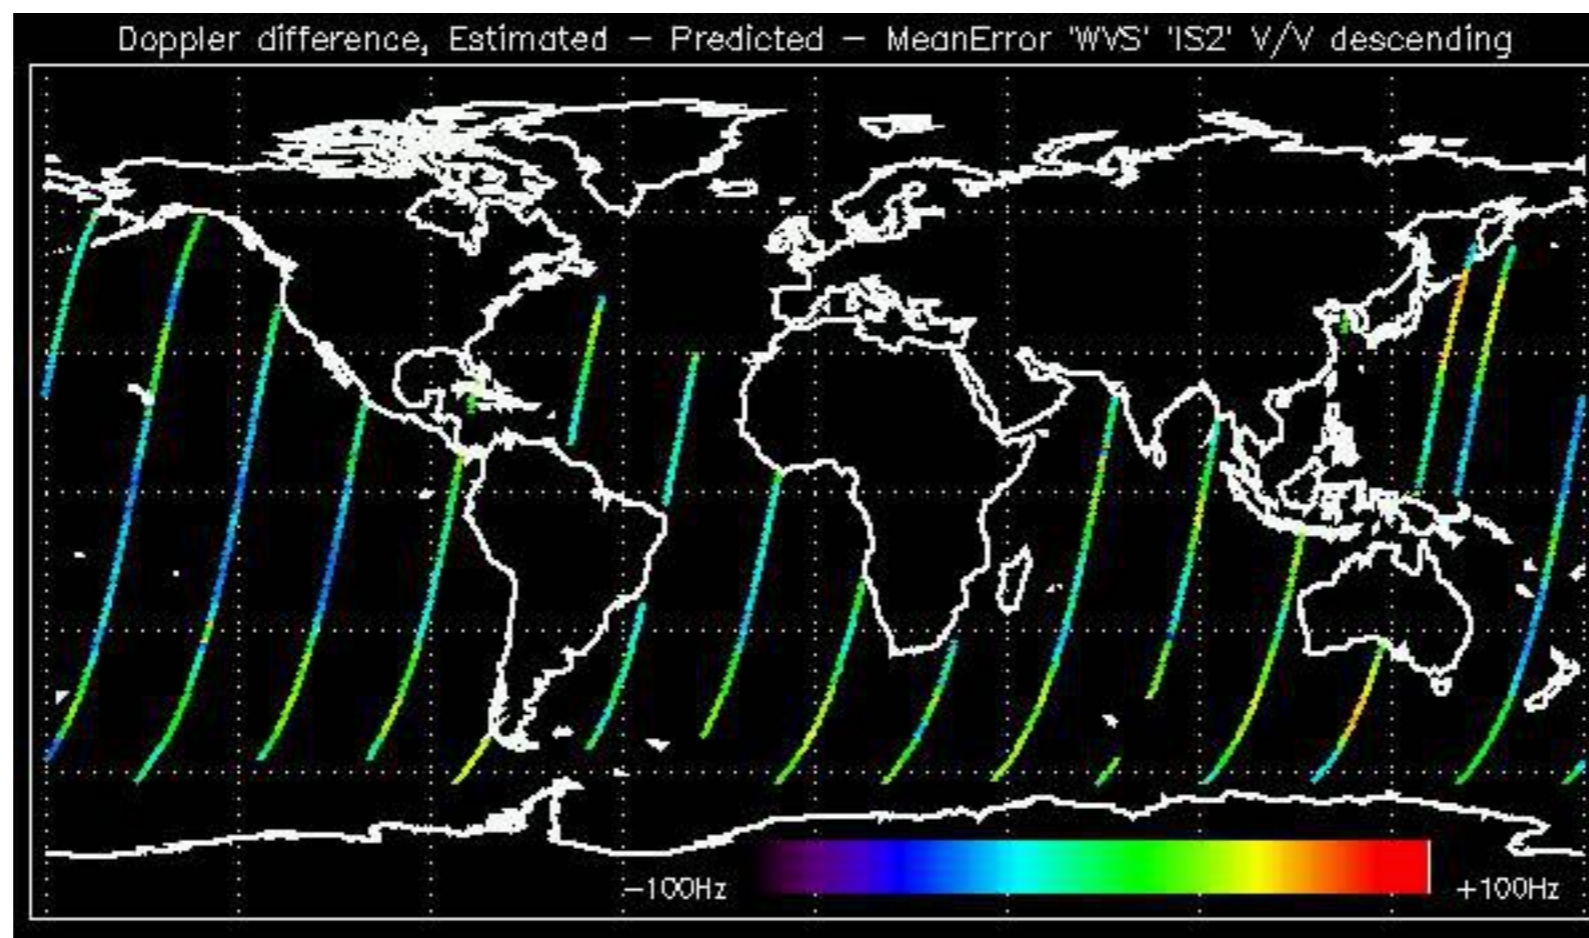

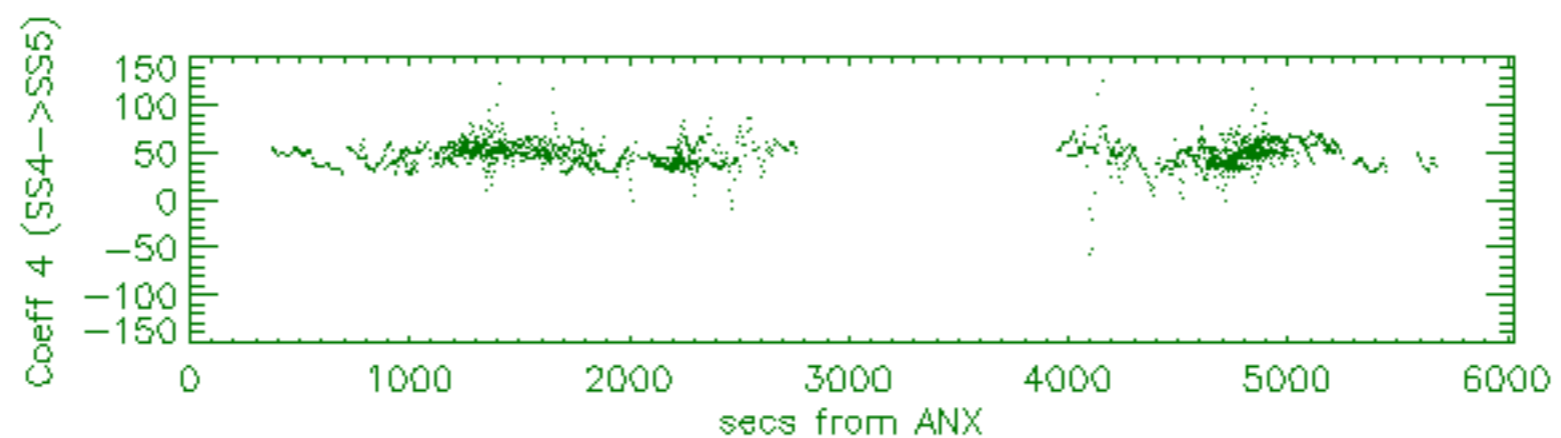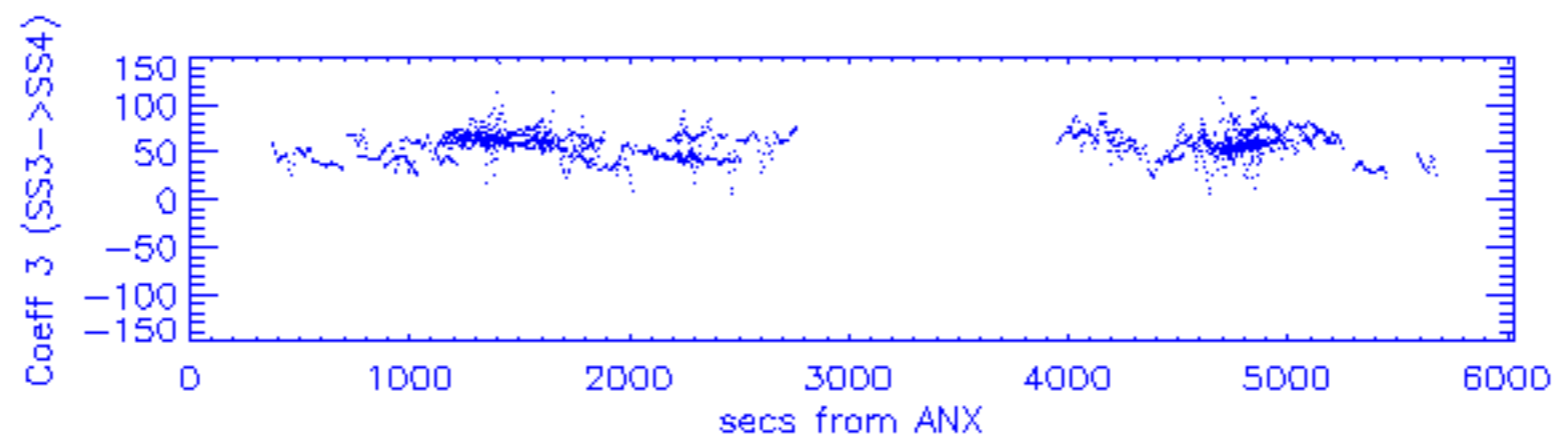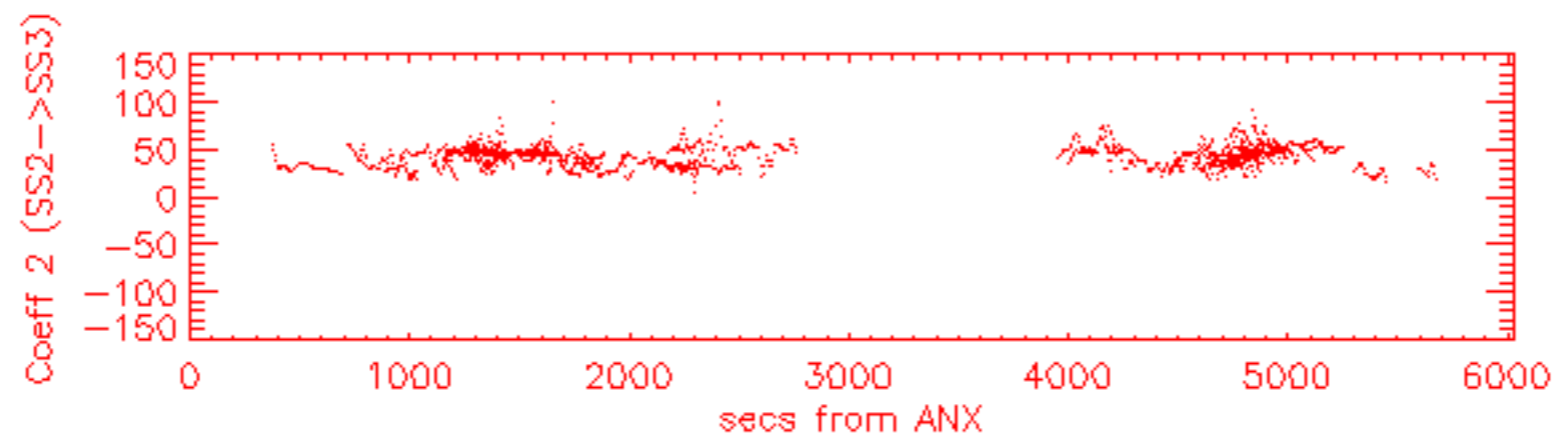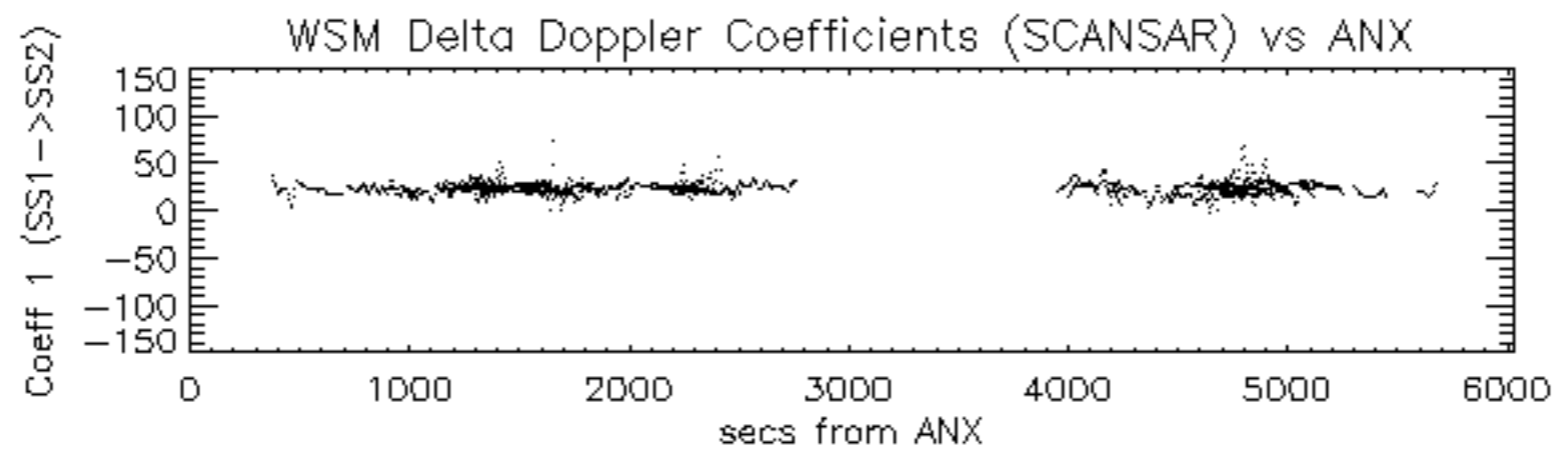


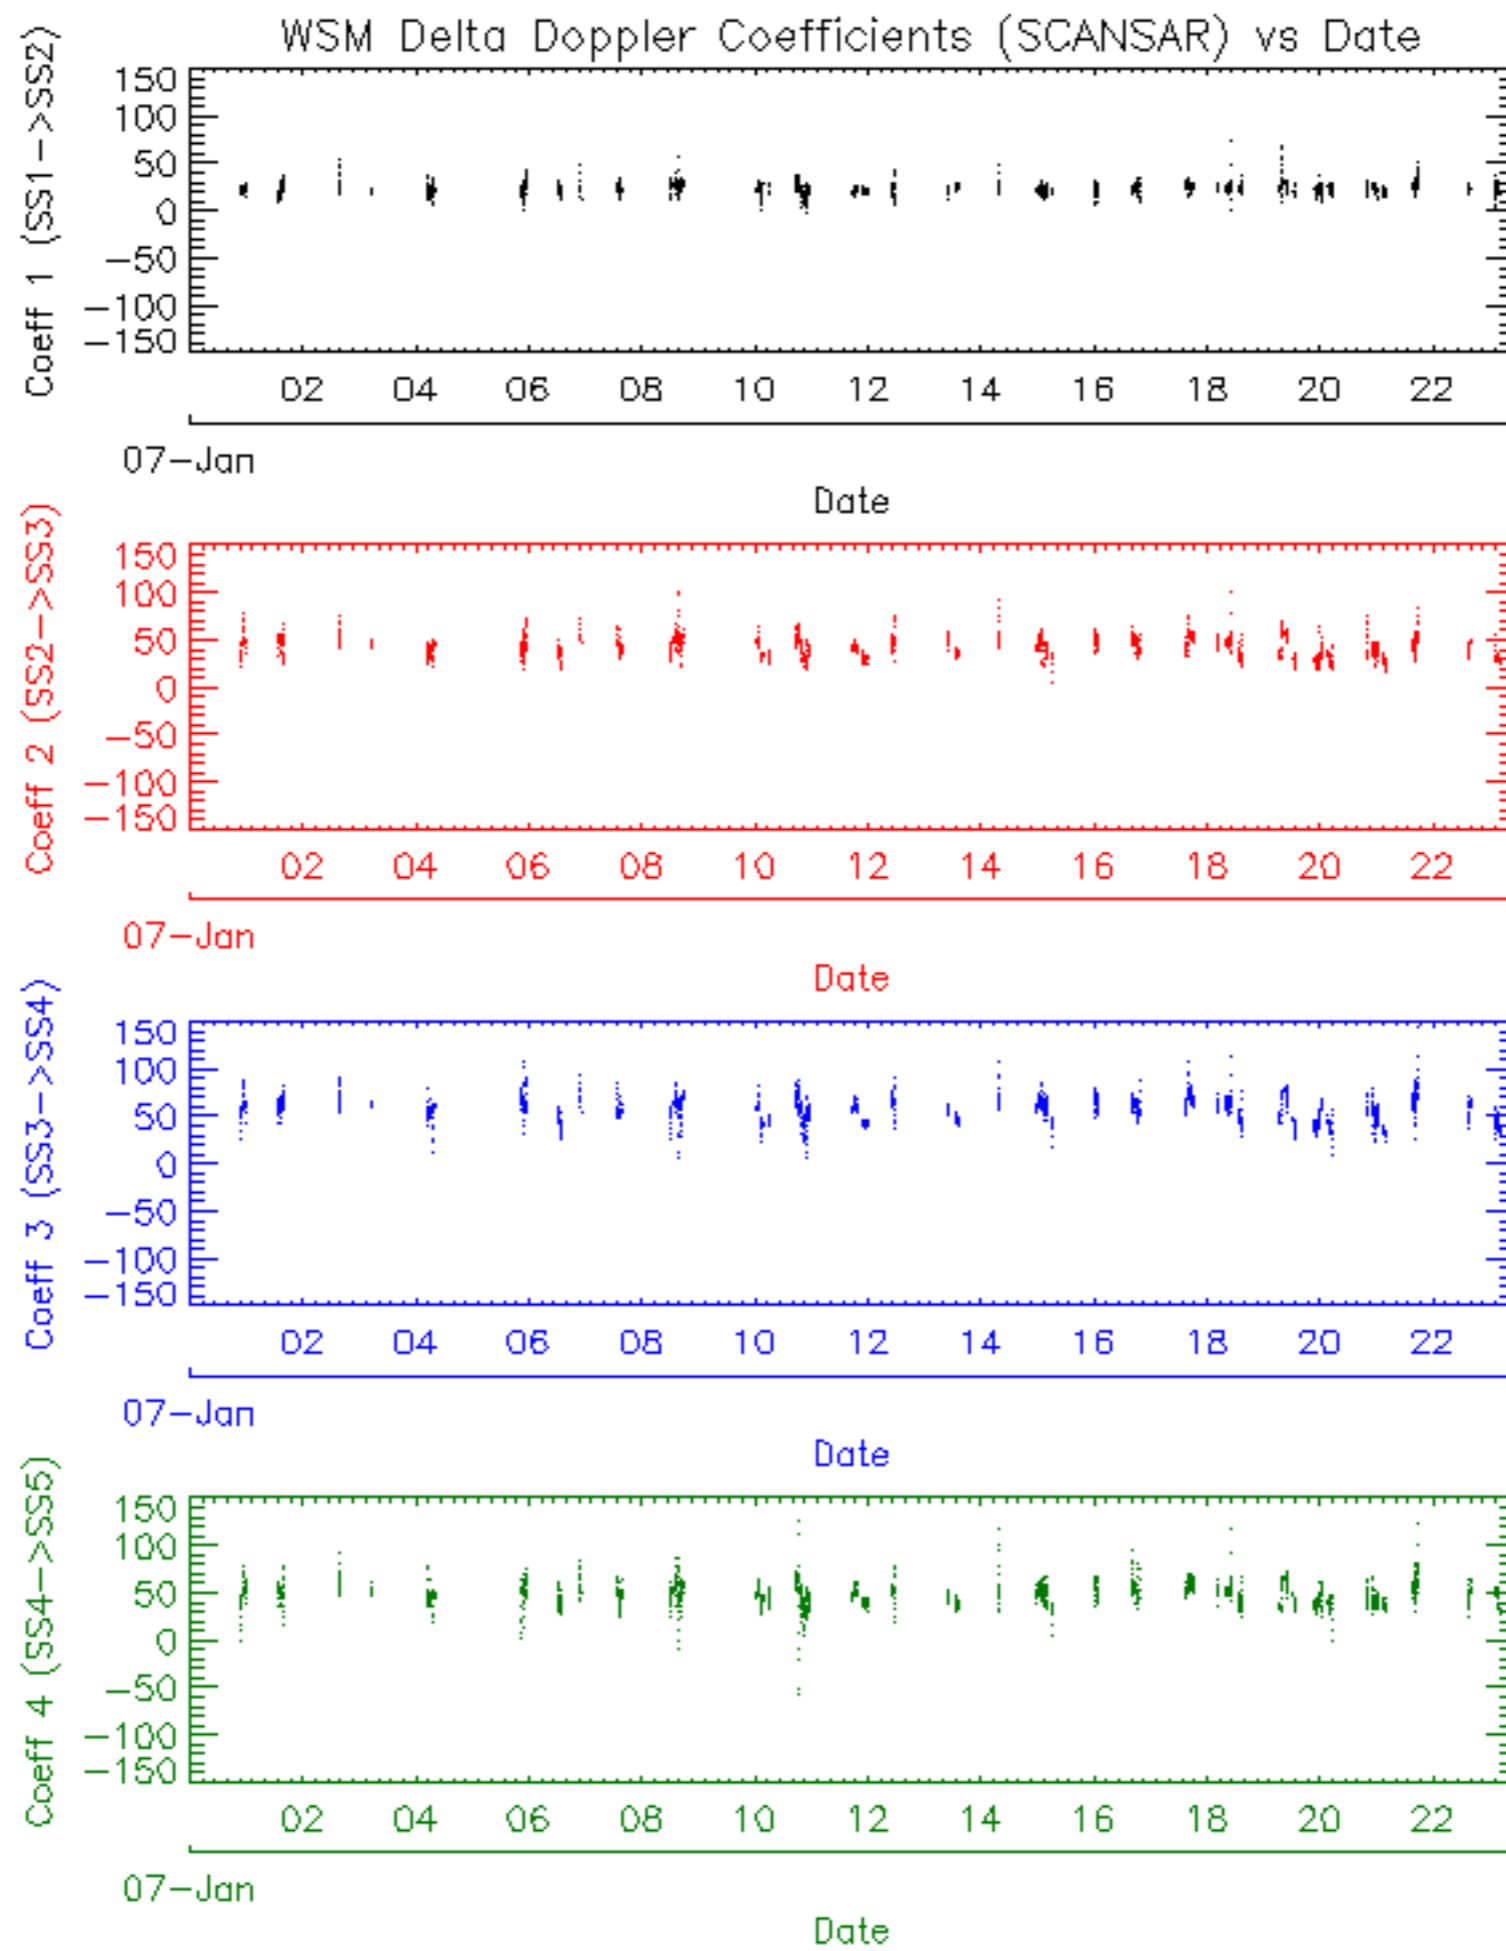

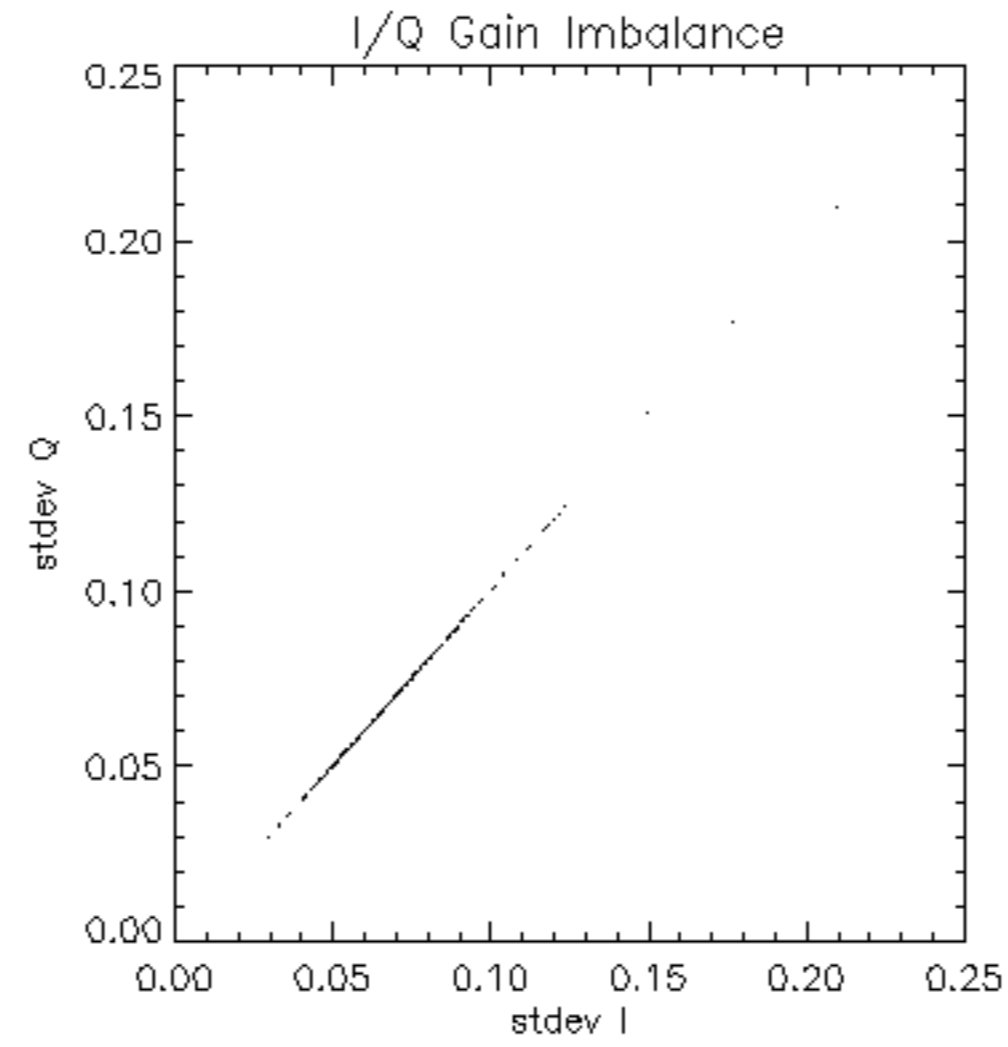


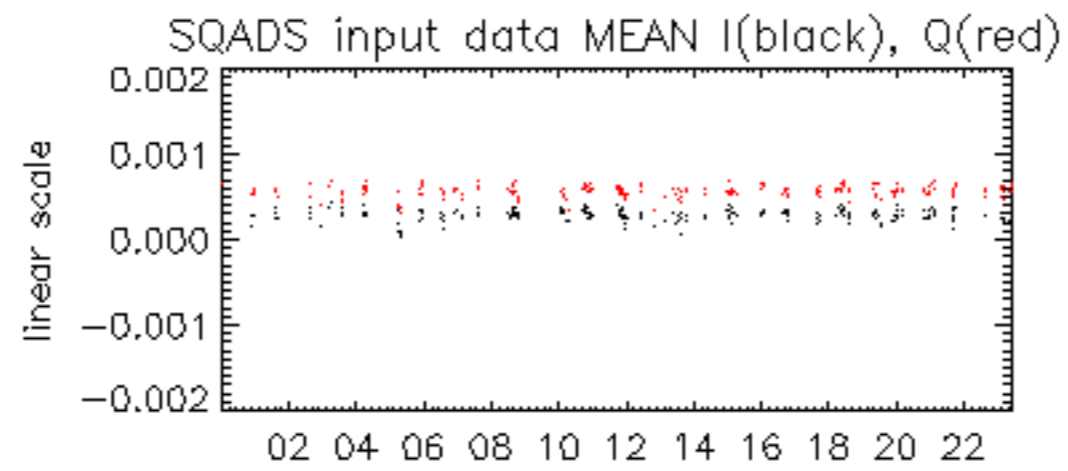




07-Jan

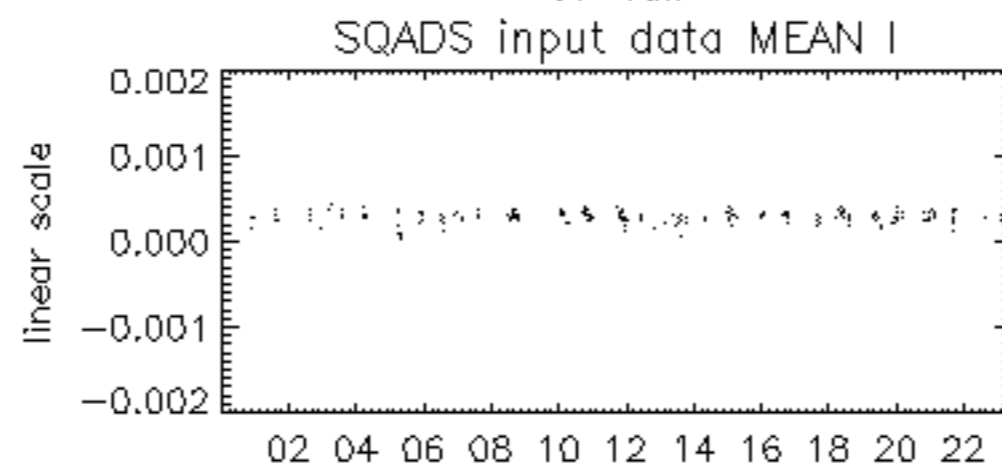



07-Jan

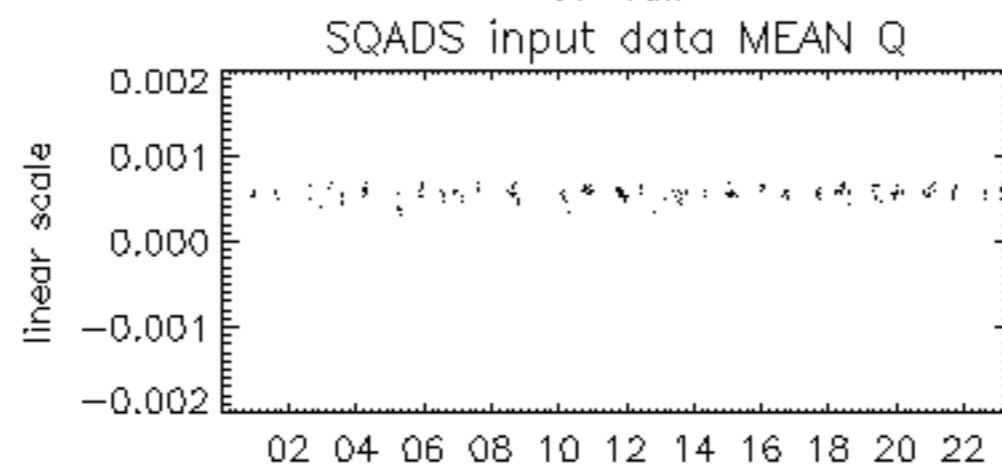


07-Jan

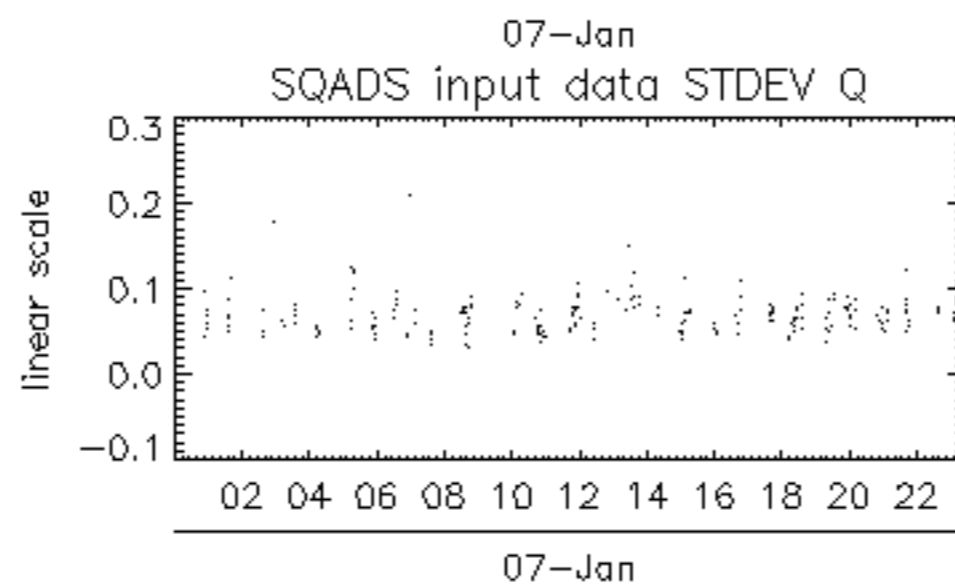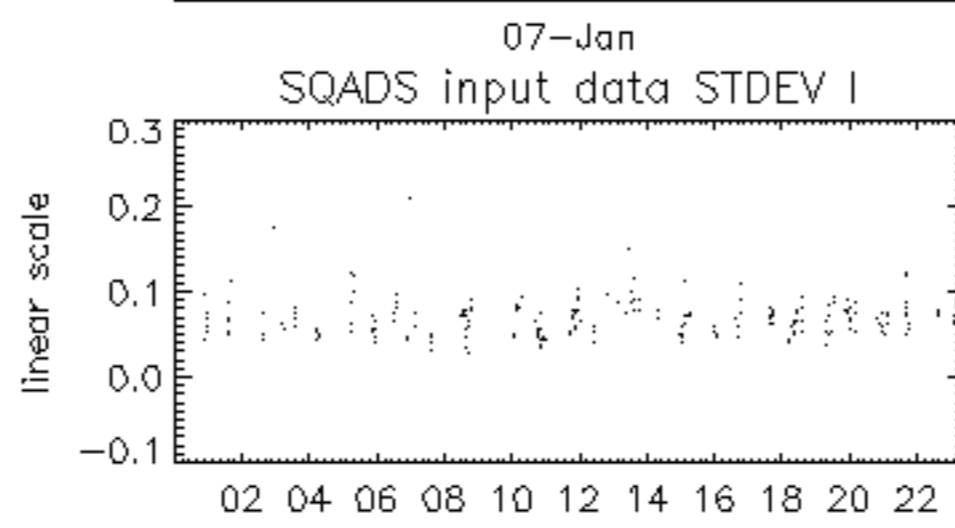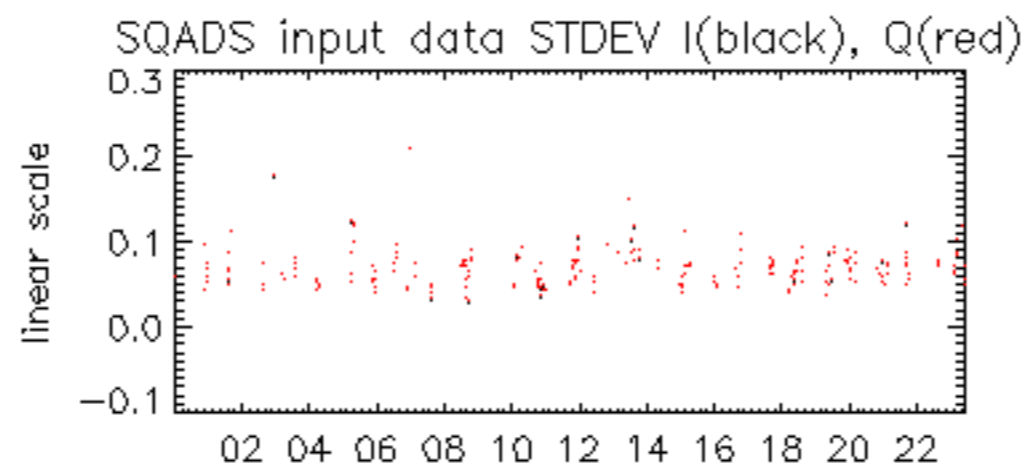


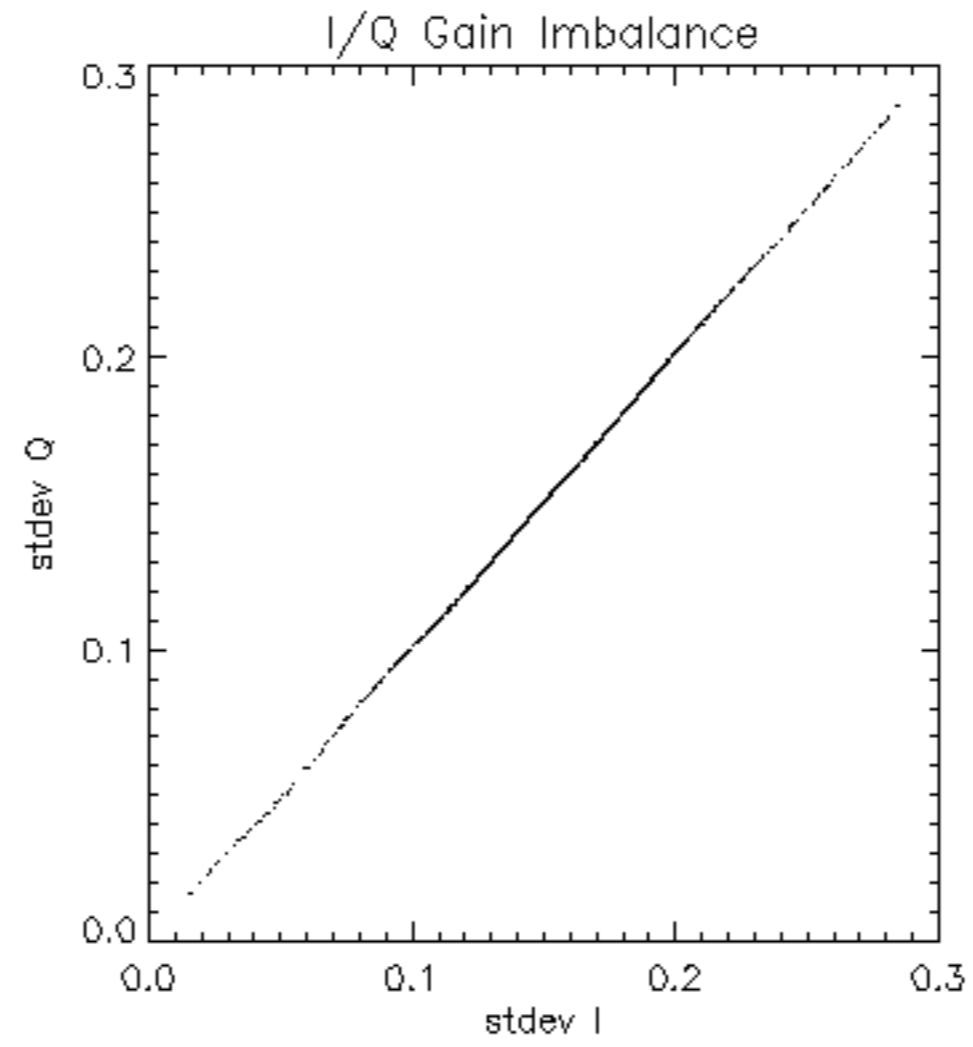

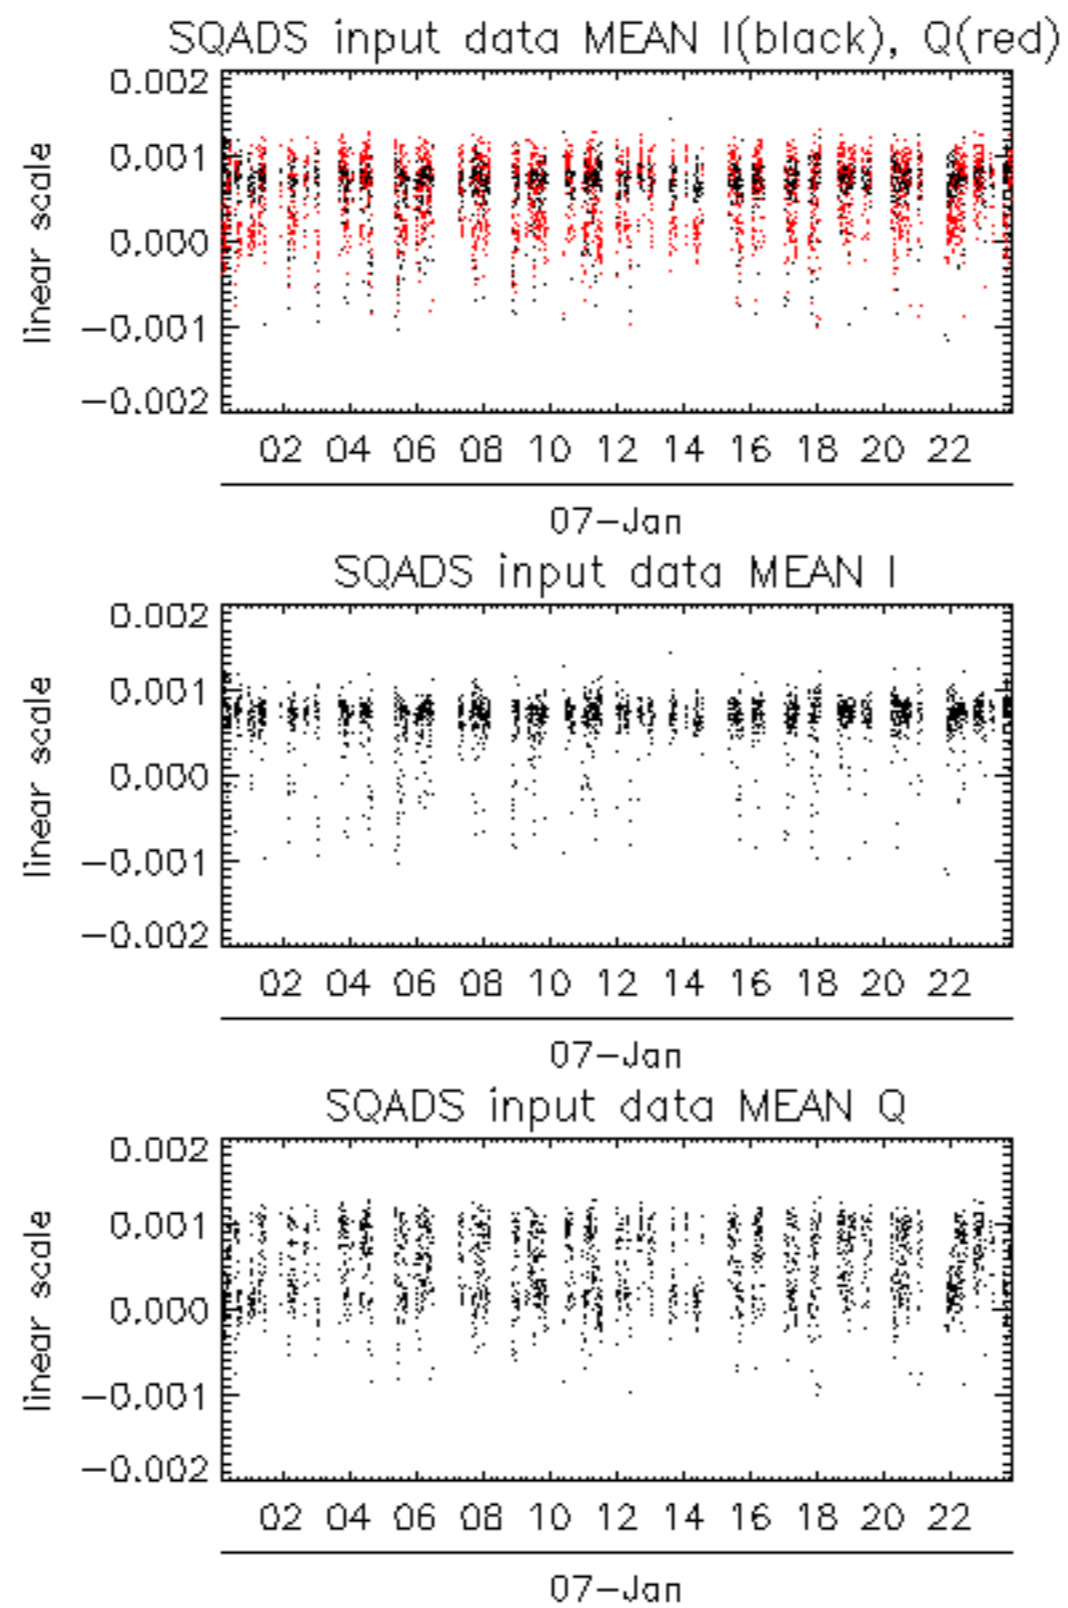


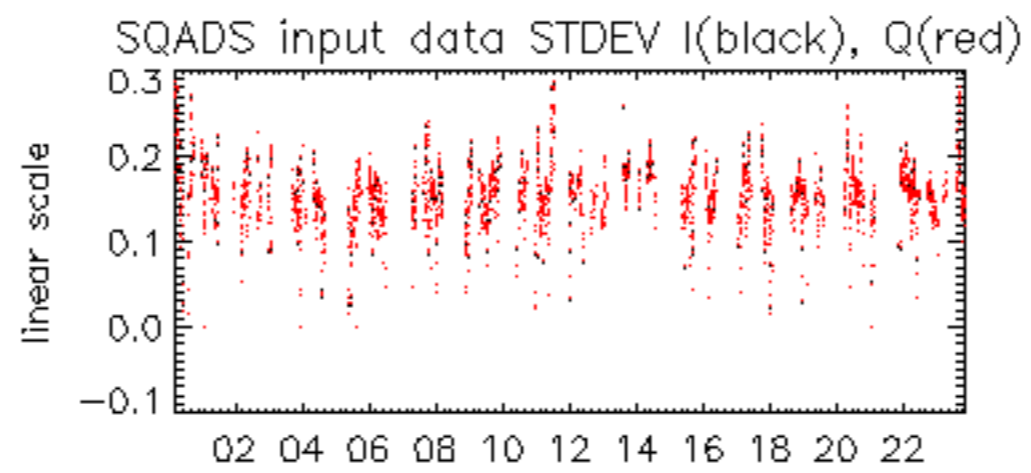

07-Jan

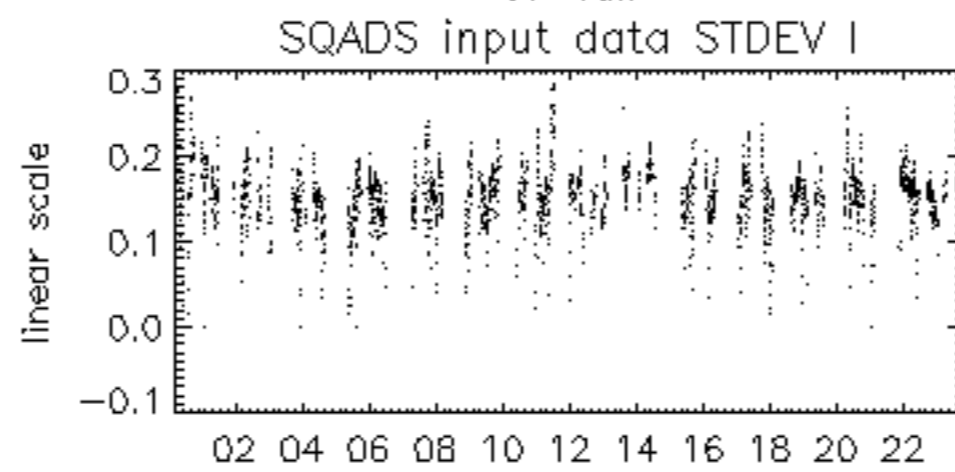

07-Jan

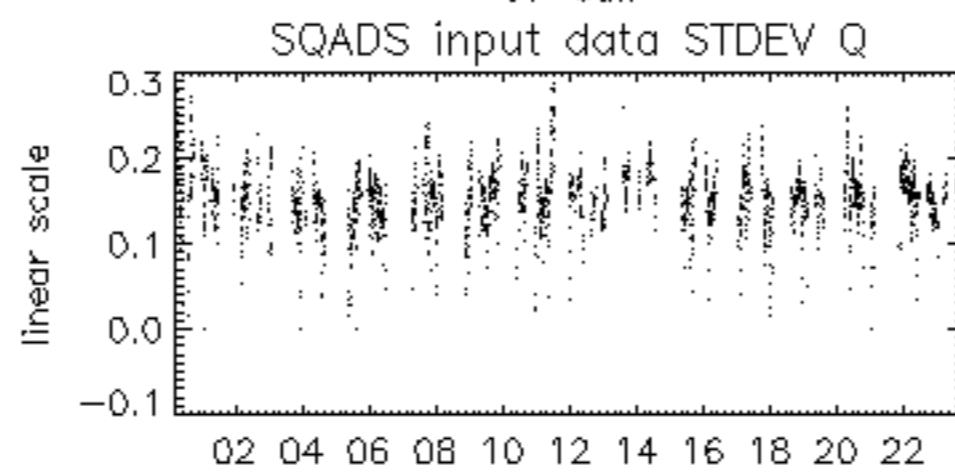

07-Jan

