

# ASAR Daily Report (ADR)

Analysis from 05-APR-2007 00:00:00 to 05-APR-2007 23:59:59. Page generated on 06-APR-2007 05:27:01.  
View log file: ASAR\_Daily\_Report\_20070406\_0500.log. For any anomalies please contact msantuari@serco.it,mtranfaglia@serco.it.

Due to an ASAR test acquisition campaign, the daily analysis on WVS products will be based on IS4 instead of IS2 during the following periods:

From orbit 25621 (23-Jan-2007) to 25720 (30-Jan-2007) in HH polarization  
From orbit 26122 (27-Feb-2007) to 26221 (06-Mar-2007) in HH polarization  
From orbit 25721 (30-Jan-2007) to 25820 (06-Feb-2007) in VV polarization  
From orbit 26222 (06-Mar-2007) to 26321 (13-Mar-2007) in VV polarization

## SUMMARY

1. Data summary
  - 1.1 Summary tables
  - 1.2 Lists of products used
2. Auxiliary Files Analysis
  - 2.1 IECF operational ADFs list
  - 2.2 Products with wrong ADFs
3. Module Stepping Products Analysis
  - 3.1 V/V polarisation
  - 3.2 H/H polarisation
4. Calibration Pulses Analysis
  - 4.1 Analysis for WVS IS2 V/V
    - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
    - 4.1.2 All Rows Analysis for WVS IS2 V/V
  - 4.2 Analysis for GM1 SS3 H/H
    - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
    - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. Doppler Analysis
  - 5.1 Analysis for WVS IS2 V/V
    - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
    - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
  - 5.2 Analysis for GM1 SS1 H/H
    - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
    - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
  - 5.3 Doppler JUMPS Analysis for WSM
6. Chirp Analysis
  - 6.1 Analysis for WSM SS1 H/H
    - 6.1.1 ScaleFactor
7. Raw Data Analysis
  - 7.1 Analysis for WVS
  - 7.2 Analysis for WSM
8. Telemetry Analysis
  - 8.1 Number of Missing Lines
  - 8.2 Number of Gaps

## 1 - Data Summary

### 1.1 - Summary tables

[ BACK TO MENU ]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	3	PDE	WS	H/H	35	PDE	IS1	H/H	2	PDE	IS2	H/H	1	PDE	WS	H/H	27	PDK	2007-04-05 06:26:41	H	320
PDE	IS2	V/V	28	PDK	WS	H/H	44	PDE	IS2	H/H	2	PDE	IS2	V/V	5	PDE	WS	V/V	14				
PDK	IS1	V/V	1					PDE	IS3	H/V	1	PDE	IS6	V/V	1	PDK	WS	H/H	12				
PDK	IS2	V/V	24					PDE	IS4	H/H	1	PDK	IS2	H/H	1	PDK	WS	V/V	3				
								PDE	IS4	H/V	1	PDK	IS2	V/V	4								
								PDE	IS6	H/H	1	PDK	IS3	H/H	2								
								PDE	IS6	H/V	1	PDK	IS3	V/V	1								
								PDK	IS2	H/H	1												
								PDK	IS3	H/H	1												

## 1.2 - Lists of products used

[ [BACK TO MENU](#) ]

[TXT] [XLS] [List\\_WVS\\_products\\_used](#)  
 [TXT] [XLS] [List\\_GM1\\_products\\_used](#)  
 [TXT] [XLS] [List\\_APM\\_products\\_used](#)  
 [TXT] [XLS] [List\\_IMM\\_products\\_used](#)  
 [TXT] [XLS] [List\\_WSM\\_products\\_used](#)  
 [TXT] [XLS] [List\\_MS\\_products\\_used](#)

## 2 - Auxiliary Files Analysis

### 2.1 - IECF operational ADFs list

[ [BACK TO MENU](#) ]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20070222_190441_20070204_165113_20071231_000000
ASA_INS_AXVIEC20070306_164819_20070307_060000_20071231_000000
ASA_XCH_AXVIEC20051219_162547_20020301_000000_20081231_000000
ASA_XCA_AXVIEC20070222_185842_20070204_165113_20071231_000000

### 2.2 - Products with wrong ADFs

[ [BACK TO MENU](#) ]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0

[TXT] [XLS] [Check\\_ADFs\\_WVS](#)  
 [TXT] [XLS] [Check\\_ADFs\\_GM1](#)  
 [TXT] [XLS] [Check\\_ADFs\\_APM](#)  
 [TXT] [XLS] [Check\\_ADFs\\_IMM](#)  
 [TXT] [XLS] [Check\\_ADFs\\_WSM](#)

## 3 - Module Stepping Products Analysis

SECOND FIXED REFERENCE


PREVIOUS PRODUCT REFERENCE

After antenna maintenance (2005-09-22/23)

Previous product in the same polarisation




Reference: 2005-09-23 05:55:14 V RxGain  
 Test : 2007-04-04 17:01:54 V

Reference: 2007-04-02 18:05:08 V RxGain  
 Test : 2007-04-04 17:01:54 V



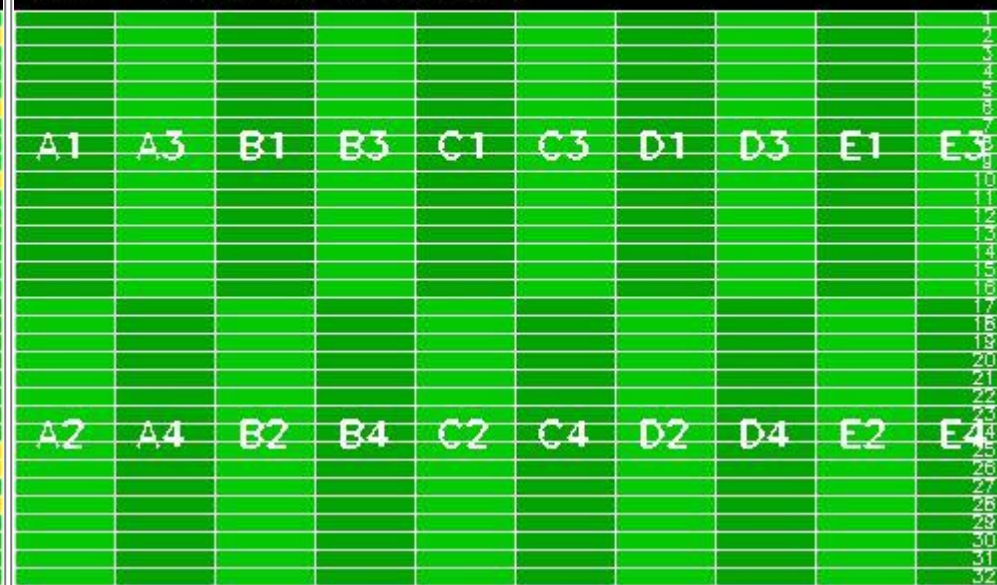


Reference: 2005-09-23 05:55:14 V RxPhase  
 Test : 2007-04-04 17:01:54 V

Reference: 2007-04-02 18:05:08 V RxPhase  
 Test : 2007-04-04 17:01:54 V

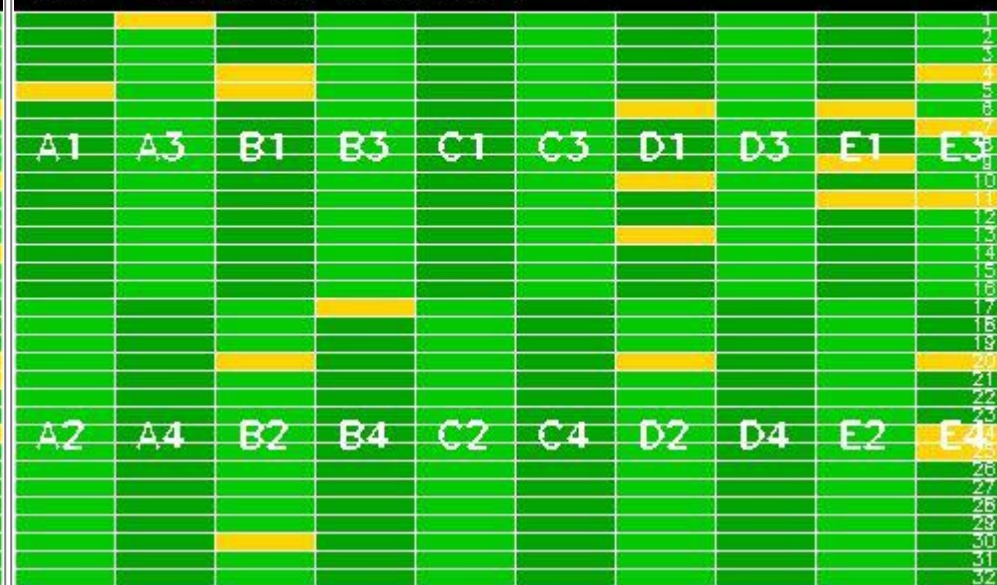



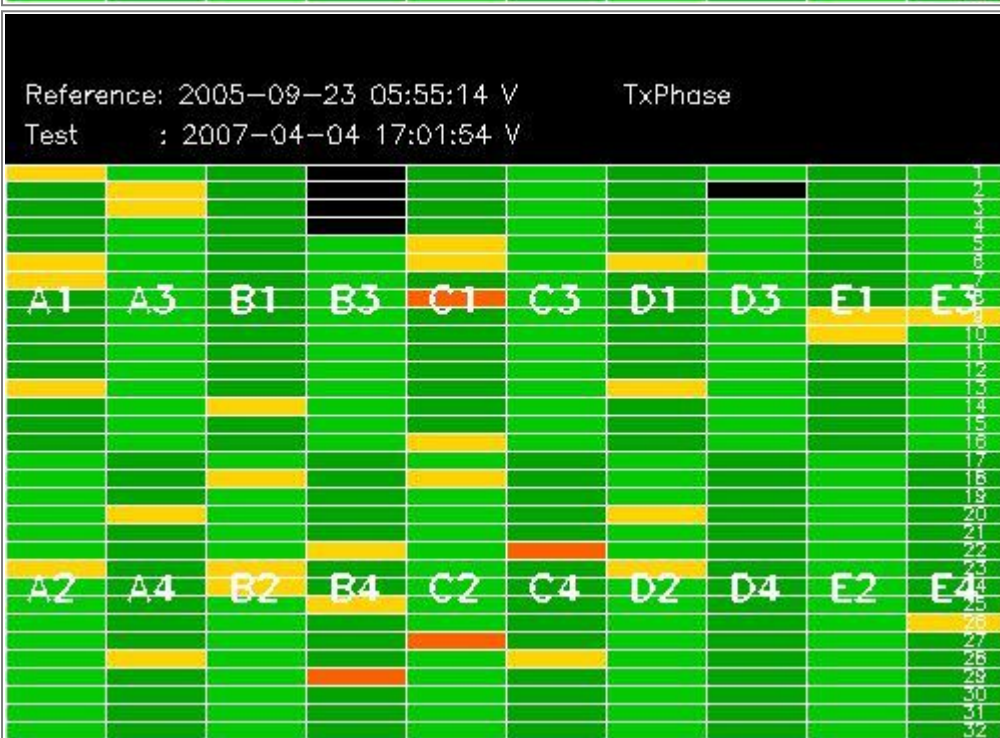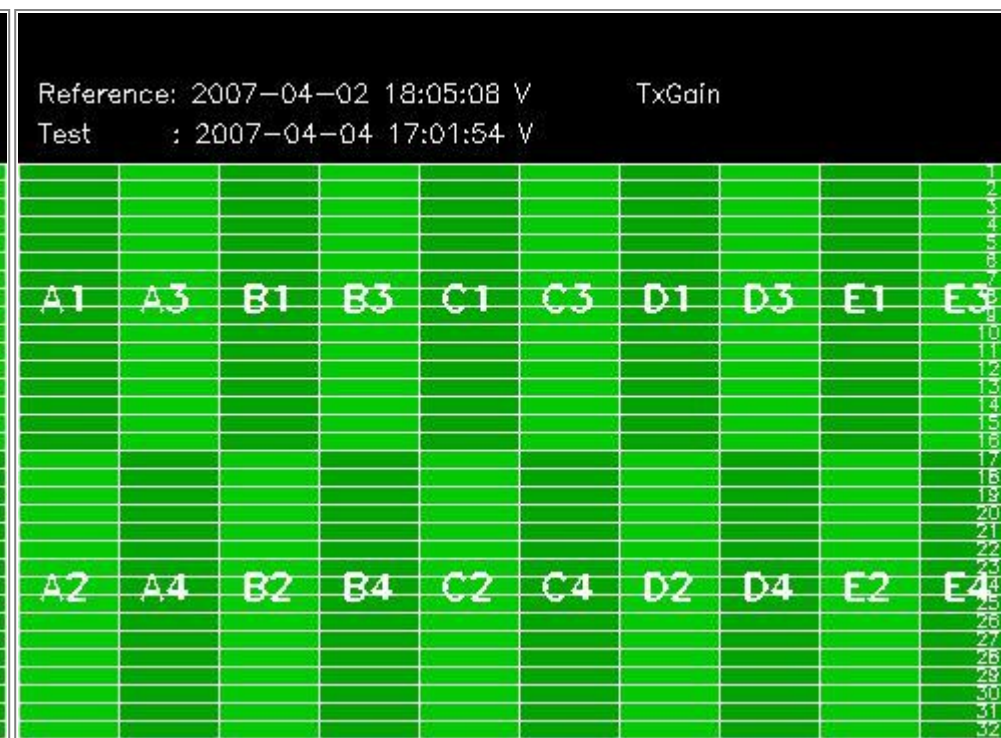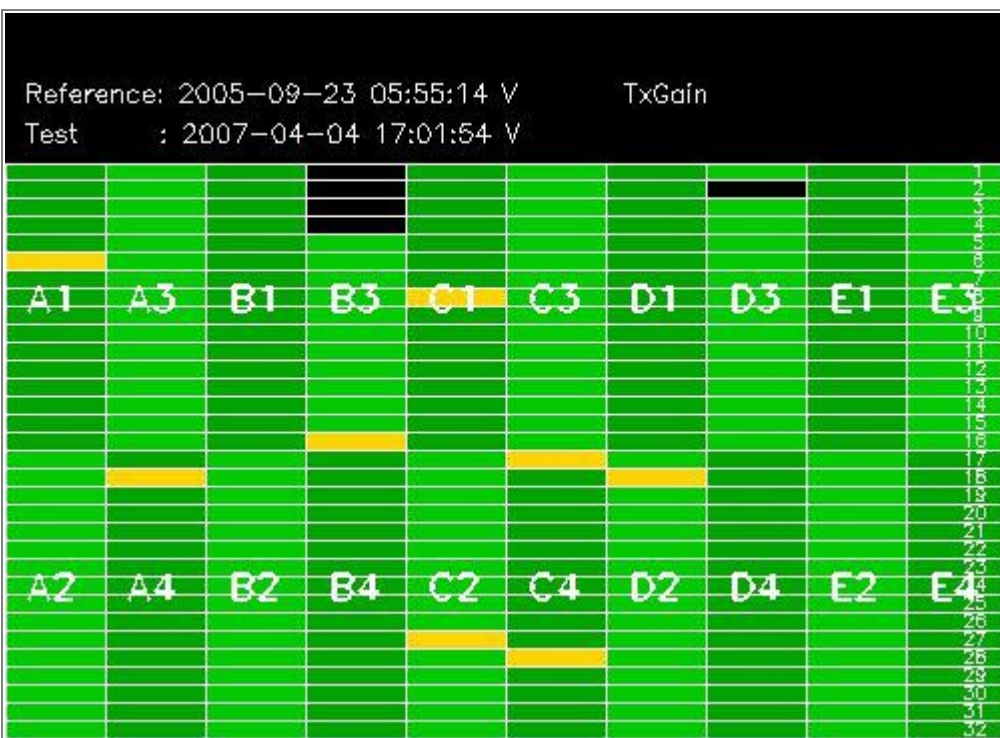




### 3.2 - H/H polarisation

[ BACK TO MENU ]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
After antenna maintenance (2005-09-22/23)	Previous product in the same polarisation





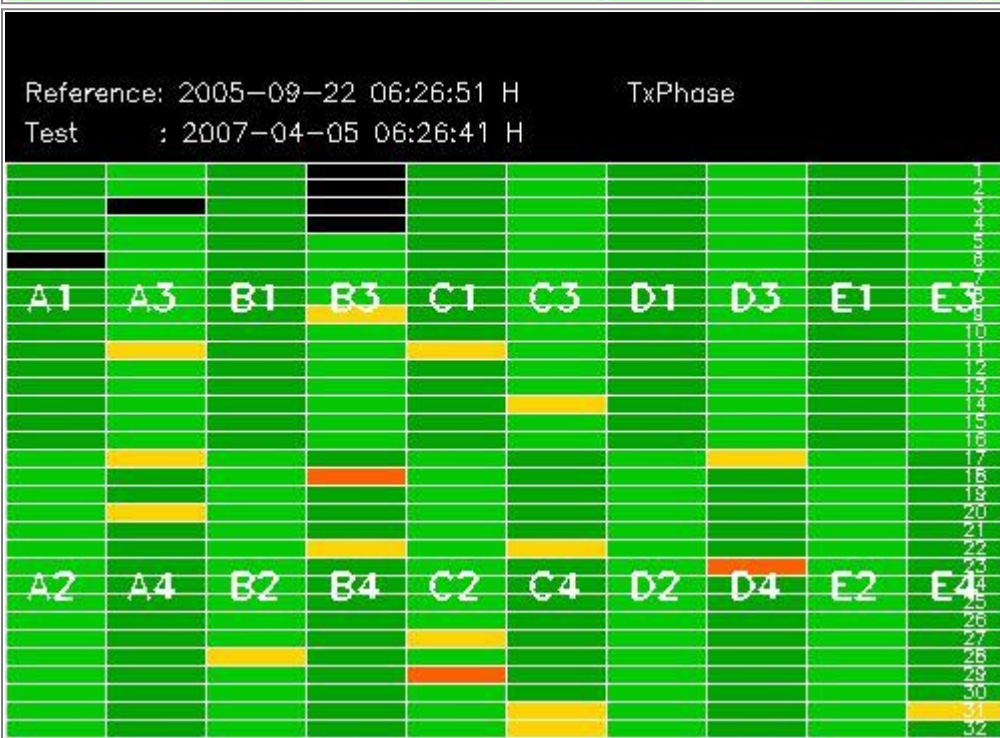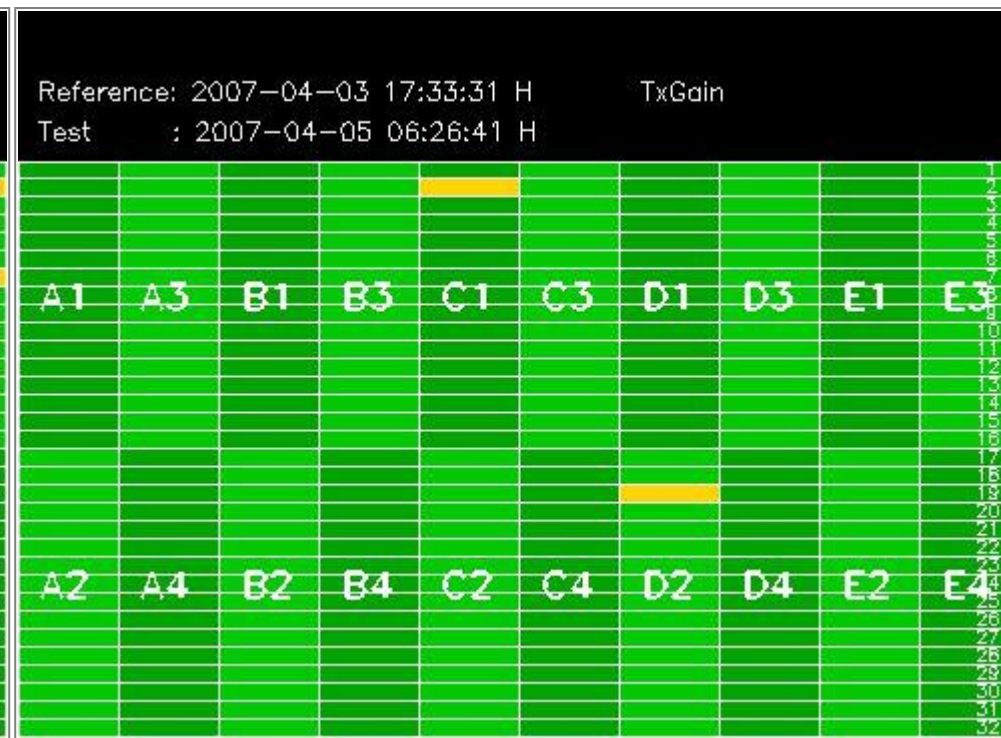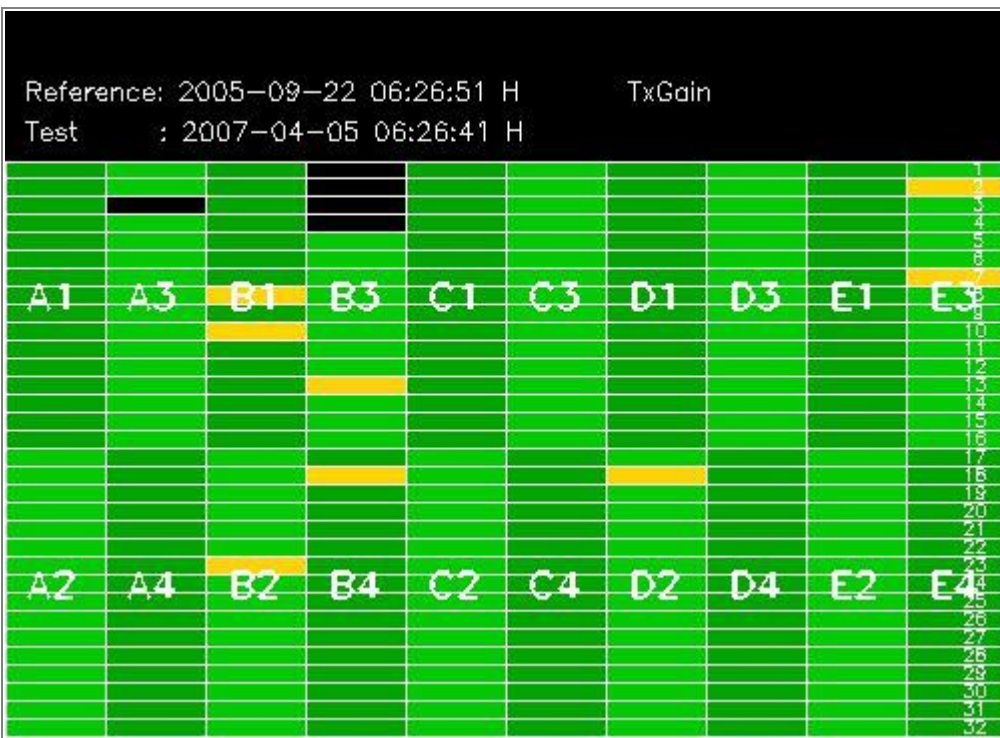

## 4 - Calibration Pulses Analysis

### 4.1 - Analysis for WVS IS2 V/V


#### 4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[ BACK TO MENU ]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]


Calibration pulses for WVS IS2 V/V

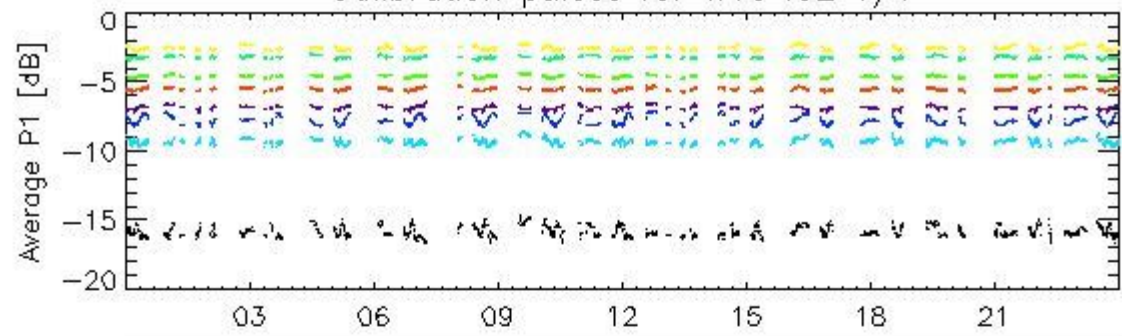


05-Apr

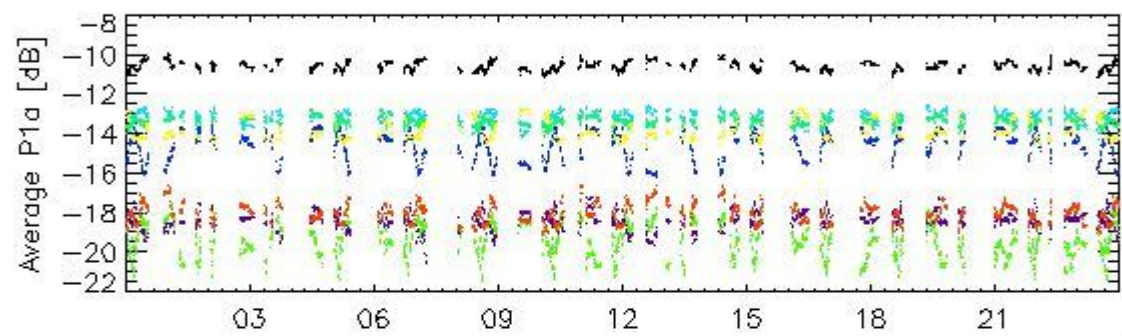

05-Apr

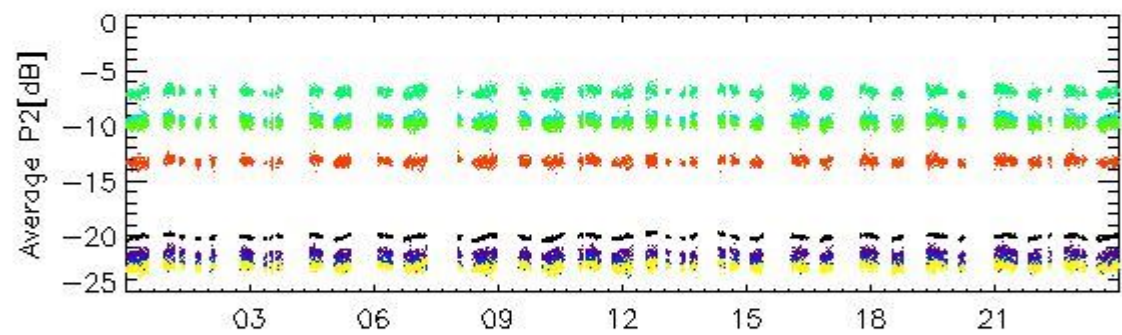


05-Apr

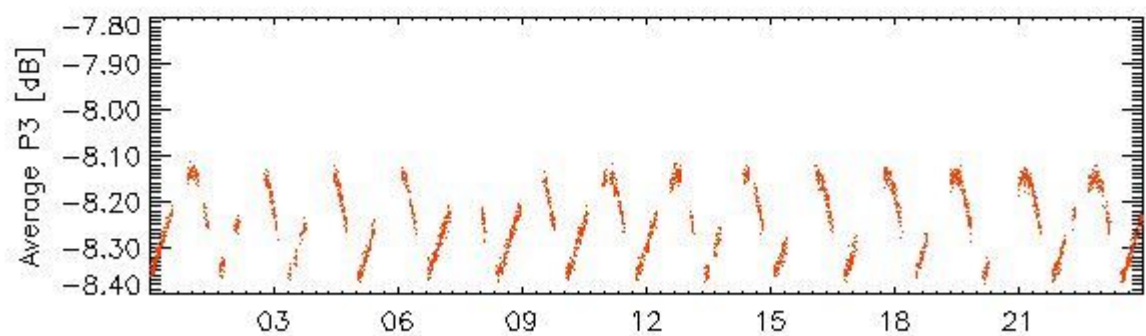

05-Apr


rows: \_ 1 \_ 5 \_ 9 \_ 13 \_ 17 \_ 21 \_ 25 \_ 29

Transmit power (P1 - P1a) for WVS IS2 V/V

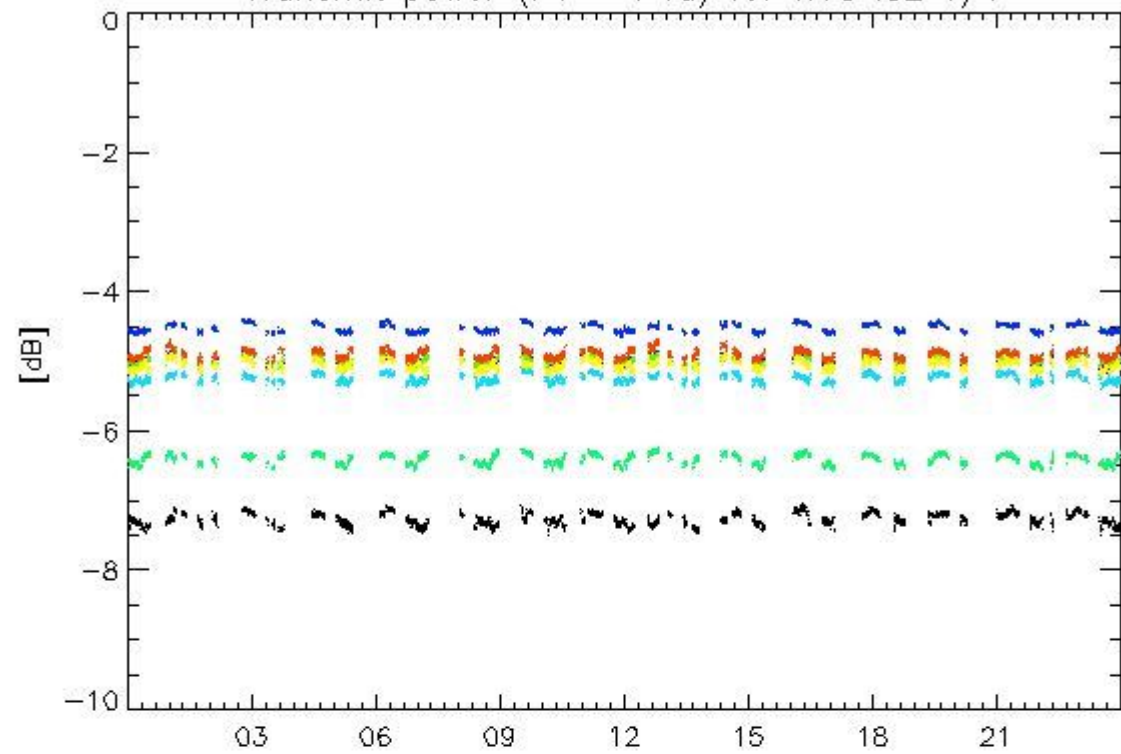

05-Apr

Transmit power (P1 - P1a) for WVS IS2 V/V

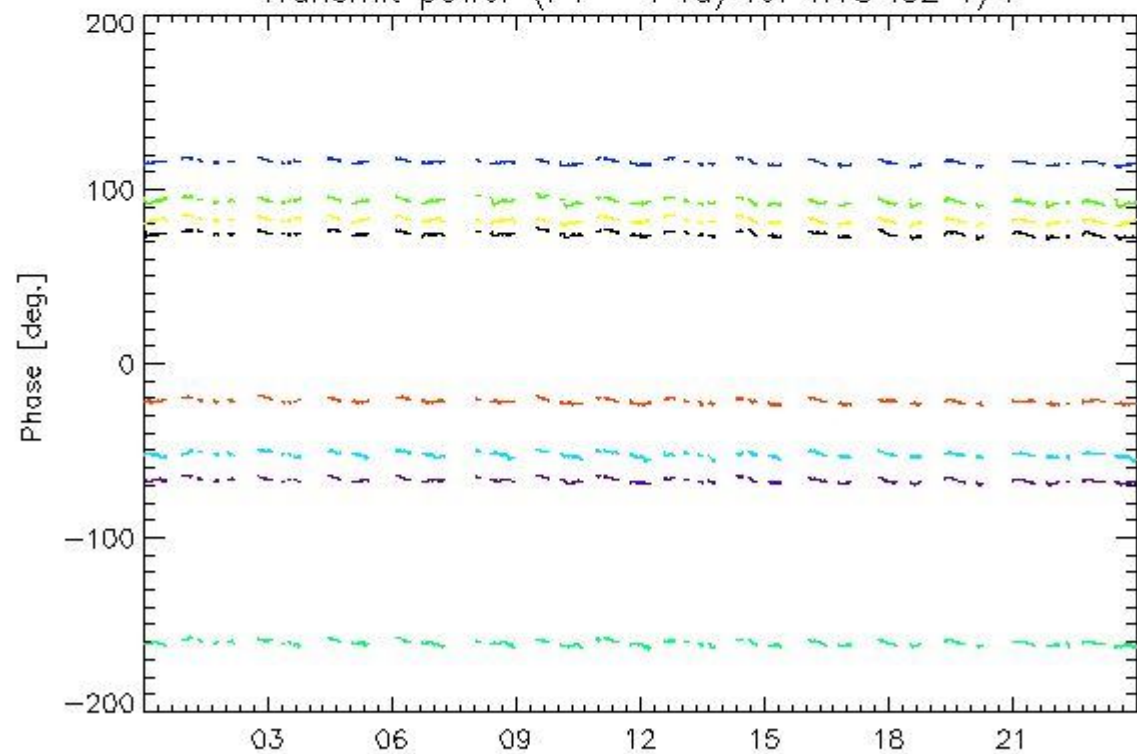

05-Apr


rows: \_ 1 \_ 5 \_ 9 \_ 13 \_ 17 \_ 21 \_ 25 \_ 29

#### 4.1.2 - All Rows Analysis for WVS IS2 VV

[\[ BACK TO MENU \]](#)





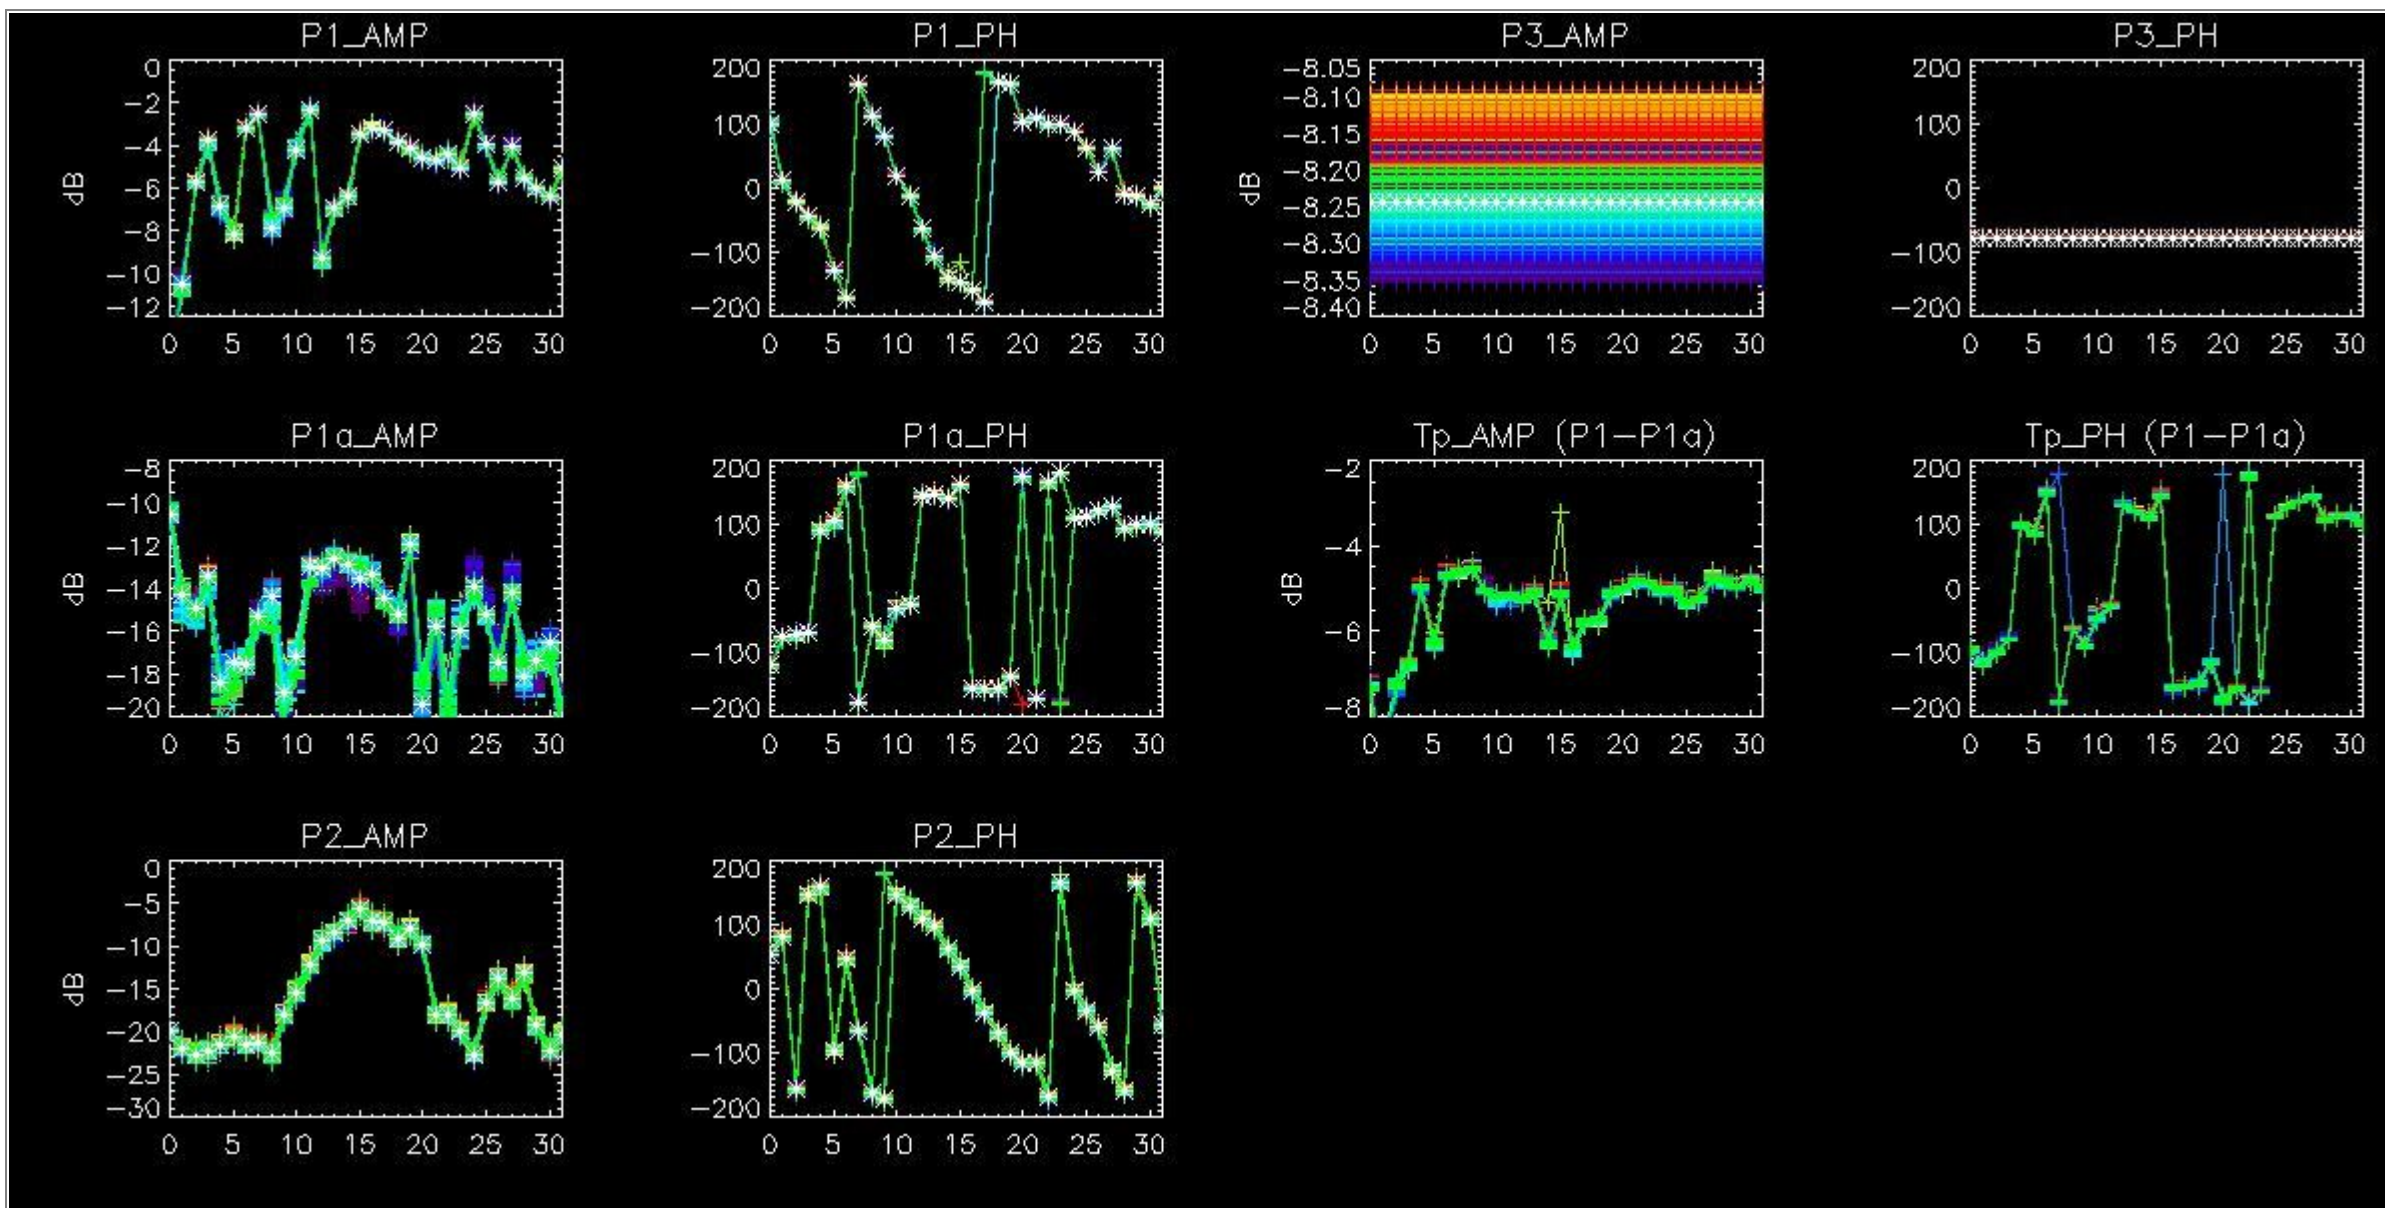

## 4.2 - Analysis for GM1 SS3 H/H

### 4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H


[ BACK TO MENU ]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]



Calibration pulses for GM1 SS3 H/H

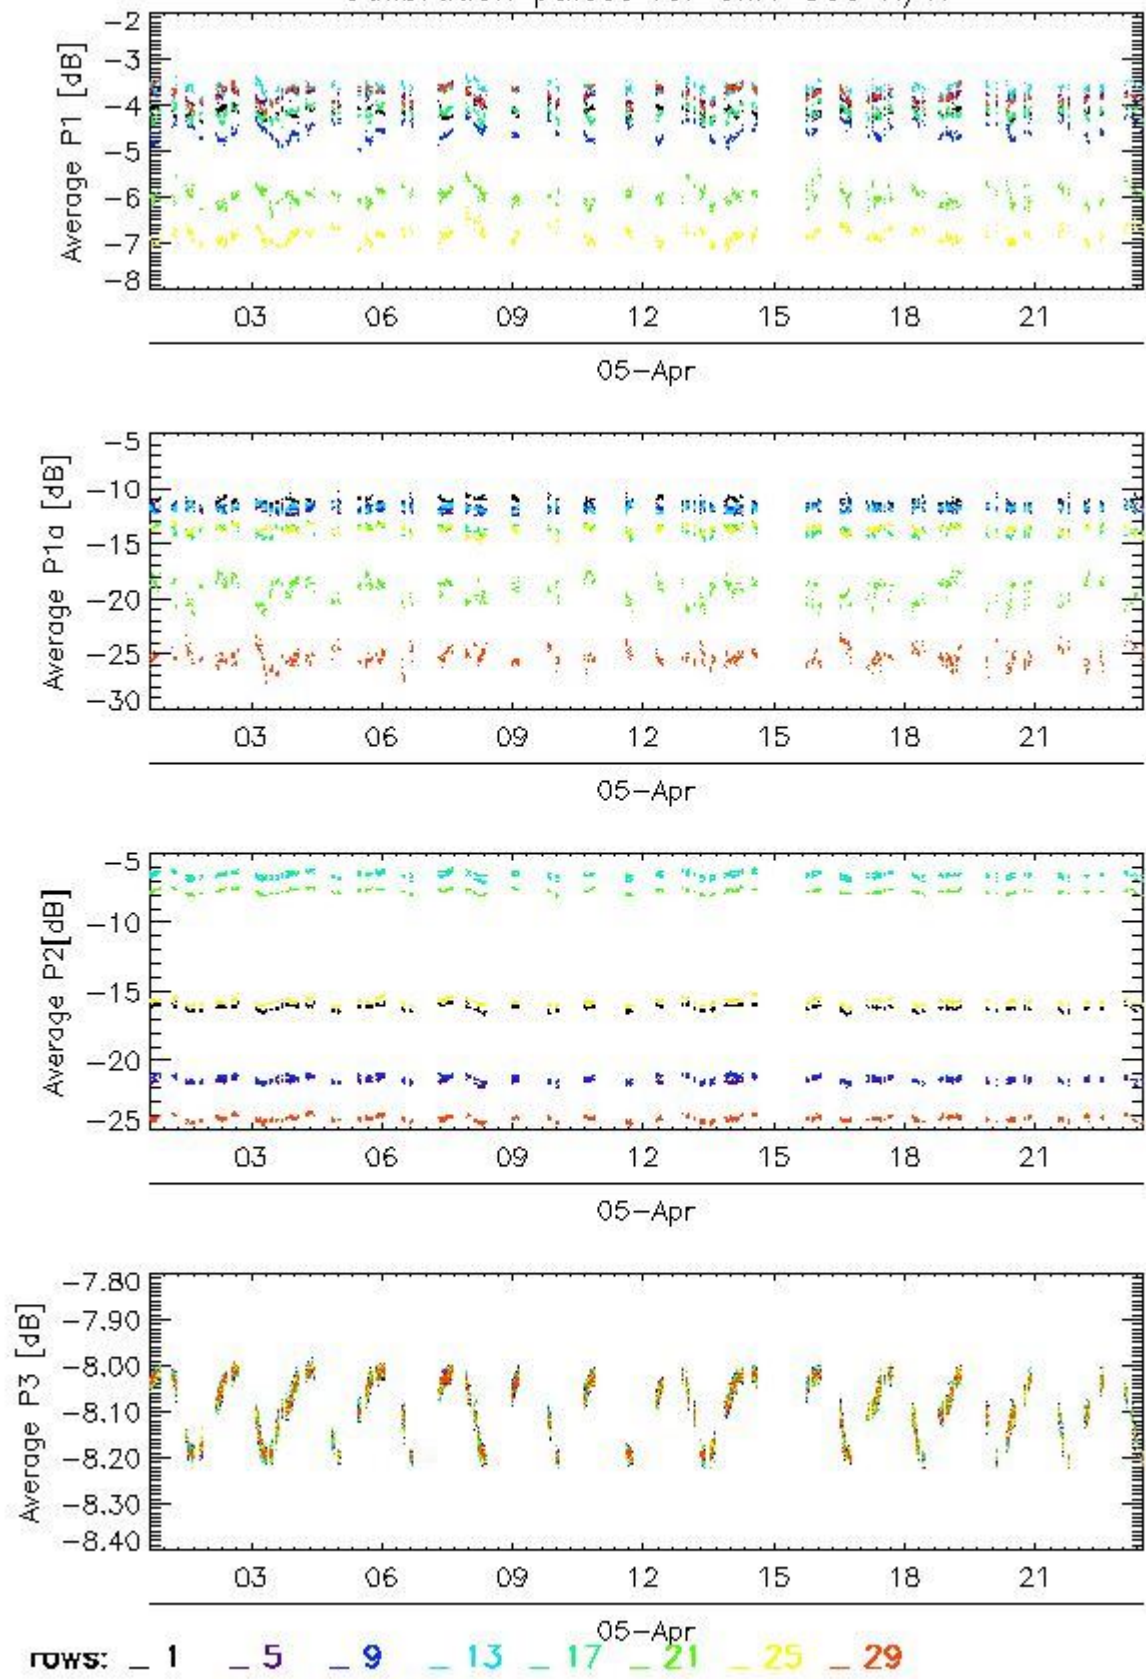


Transmit power (P1 - P1a) for GM1 SS3 H/H

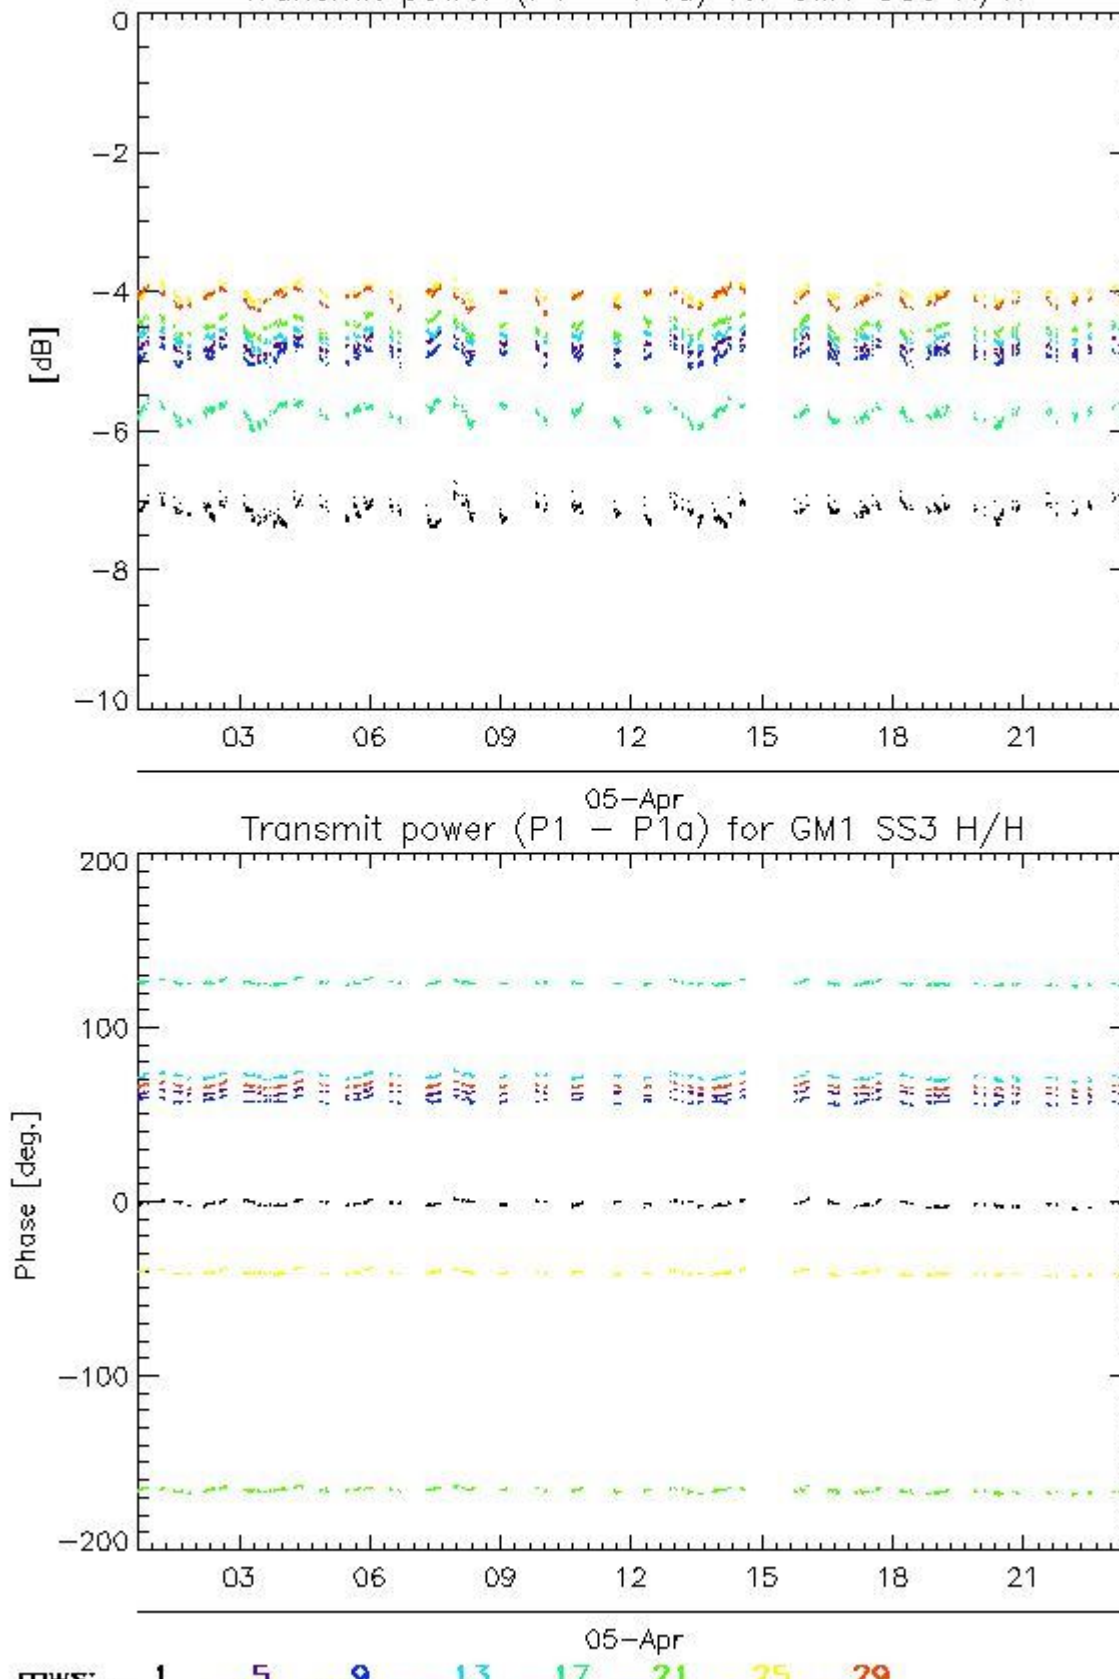

#### 4.2.2 - All Rows Analysis for GM1 SS3 H/H

[\[ BACK TO MENU \]](#)



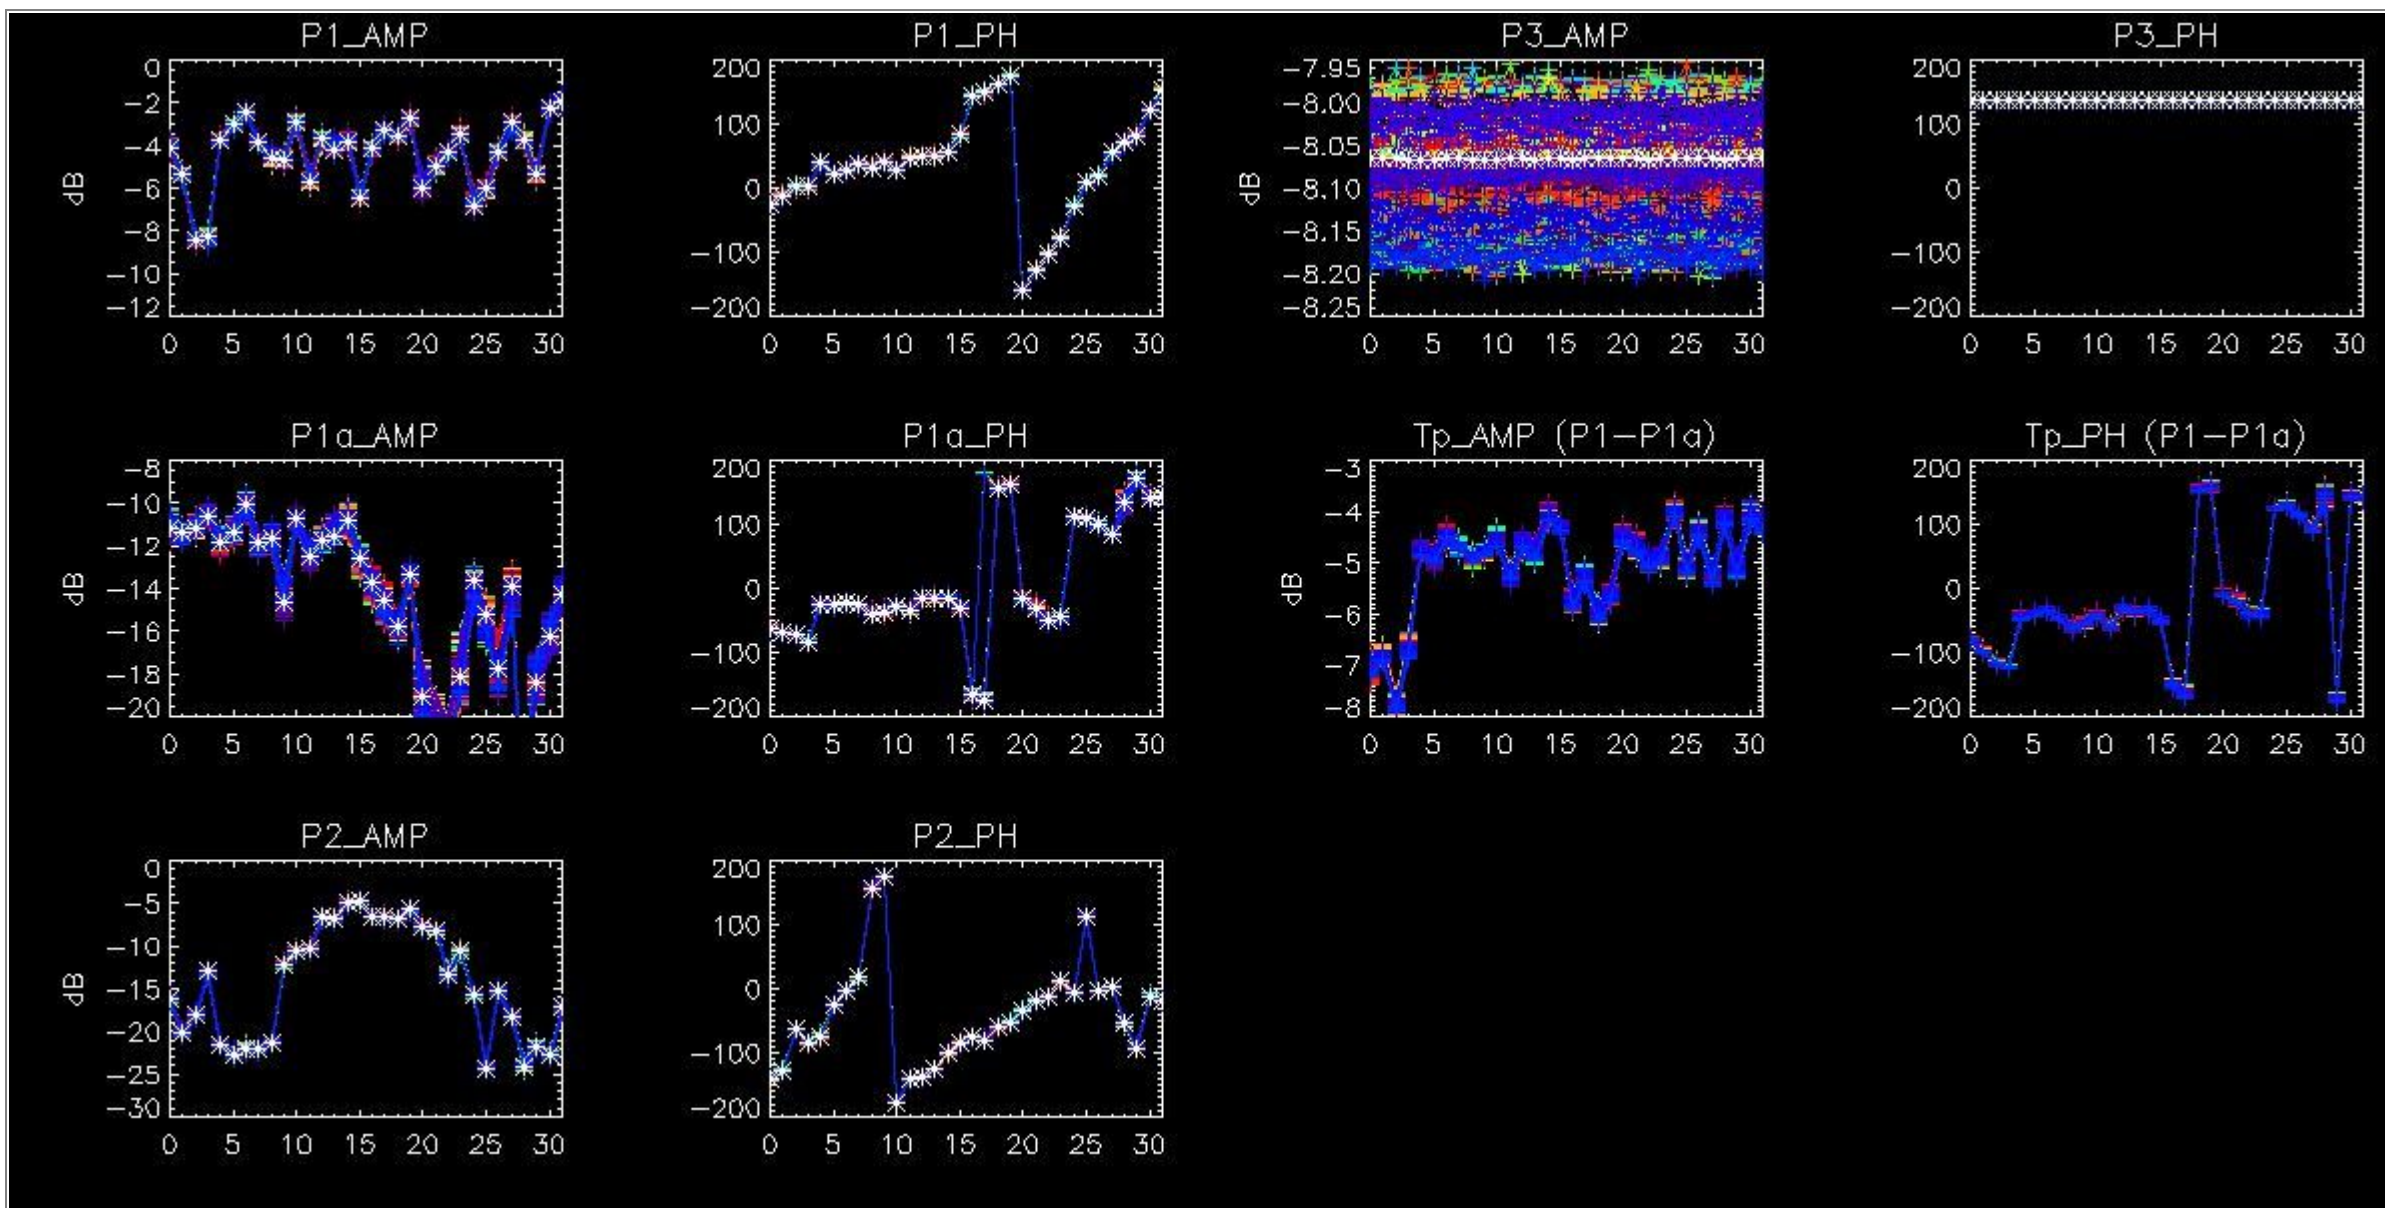


## 5 - Doppler Analysis


### 5.1 - Analysis for WVS IS2 V/V

#### 5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[ [BACK TO MENU](#) ]







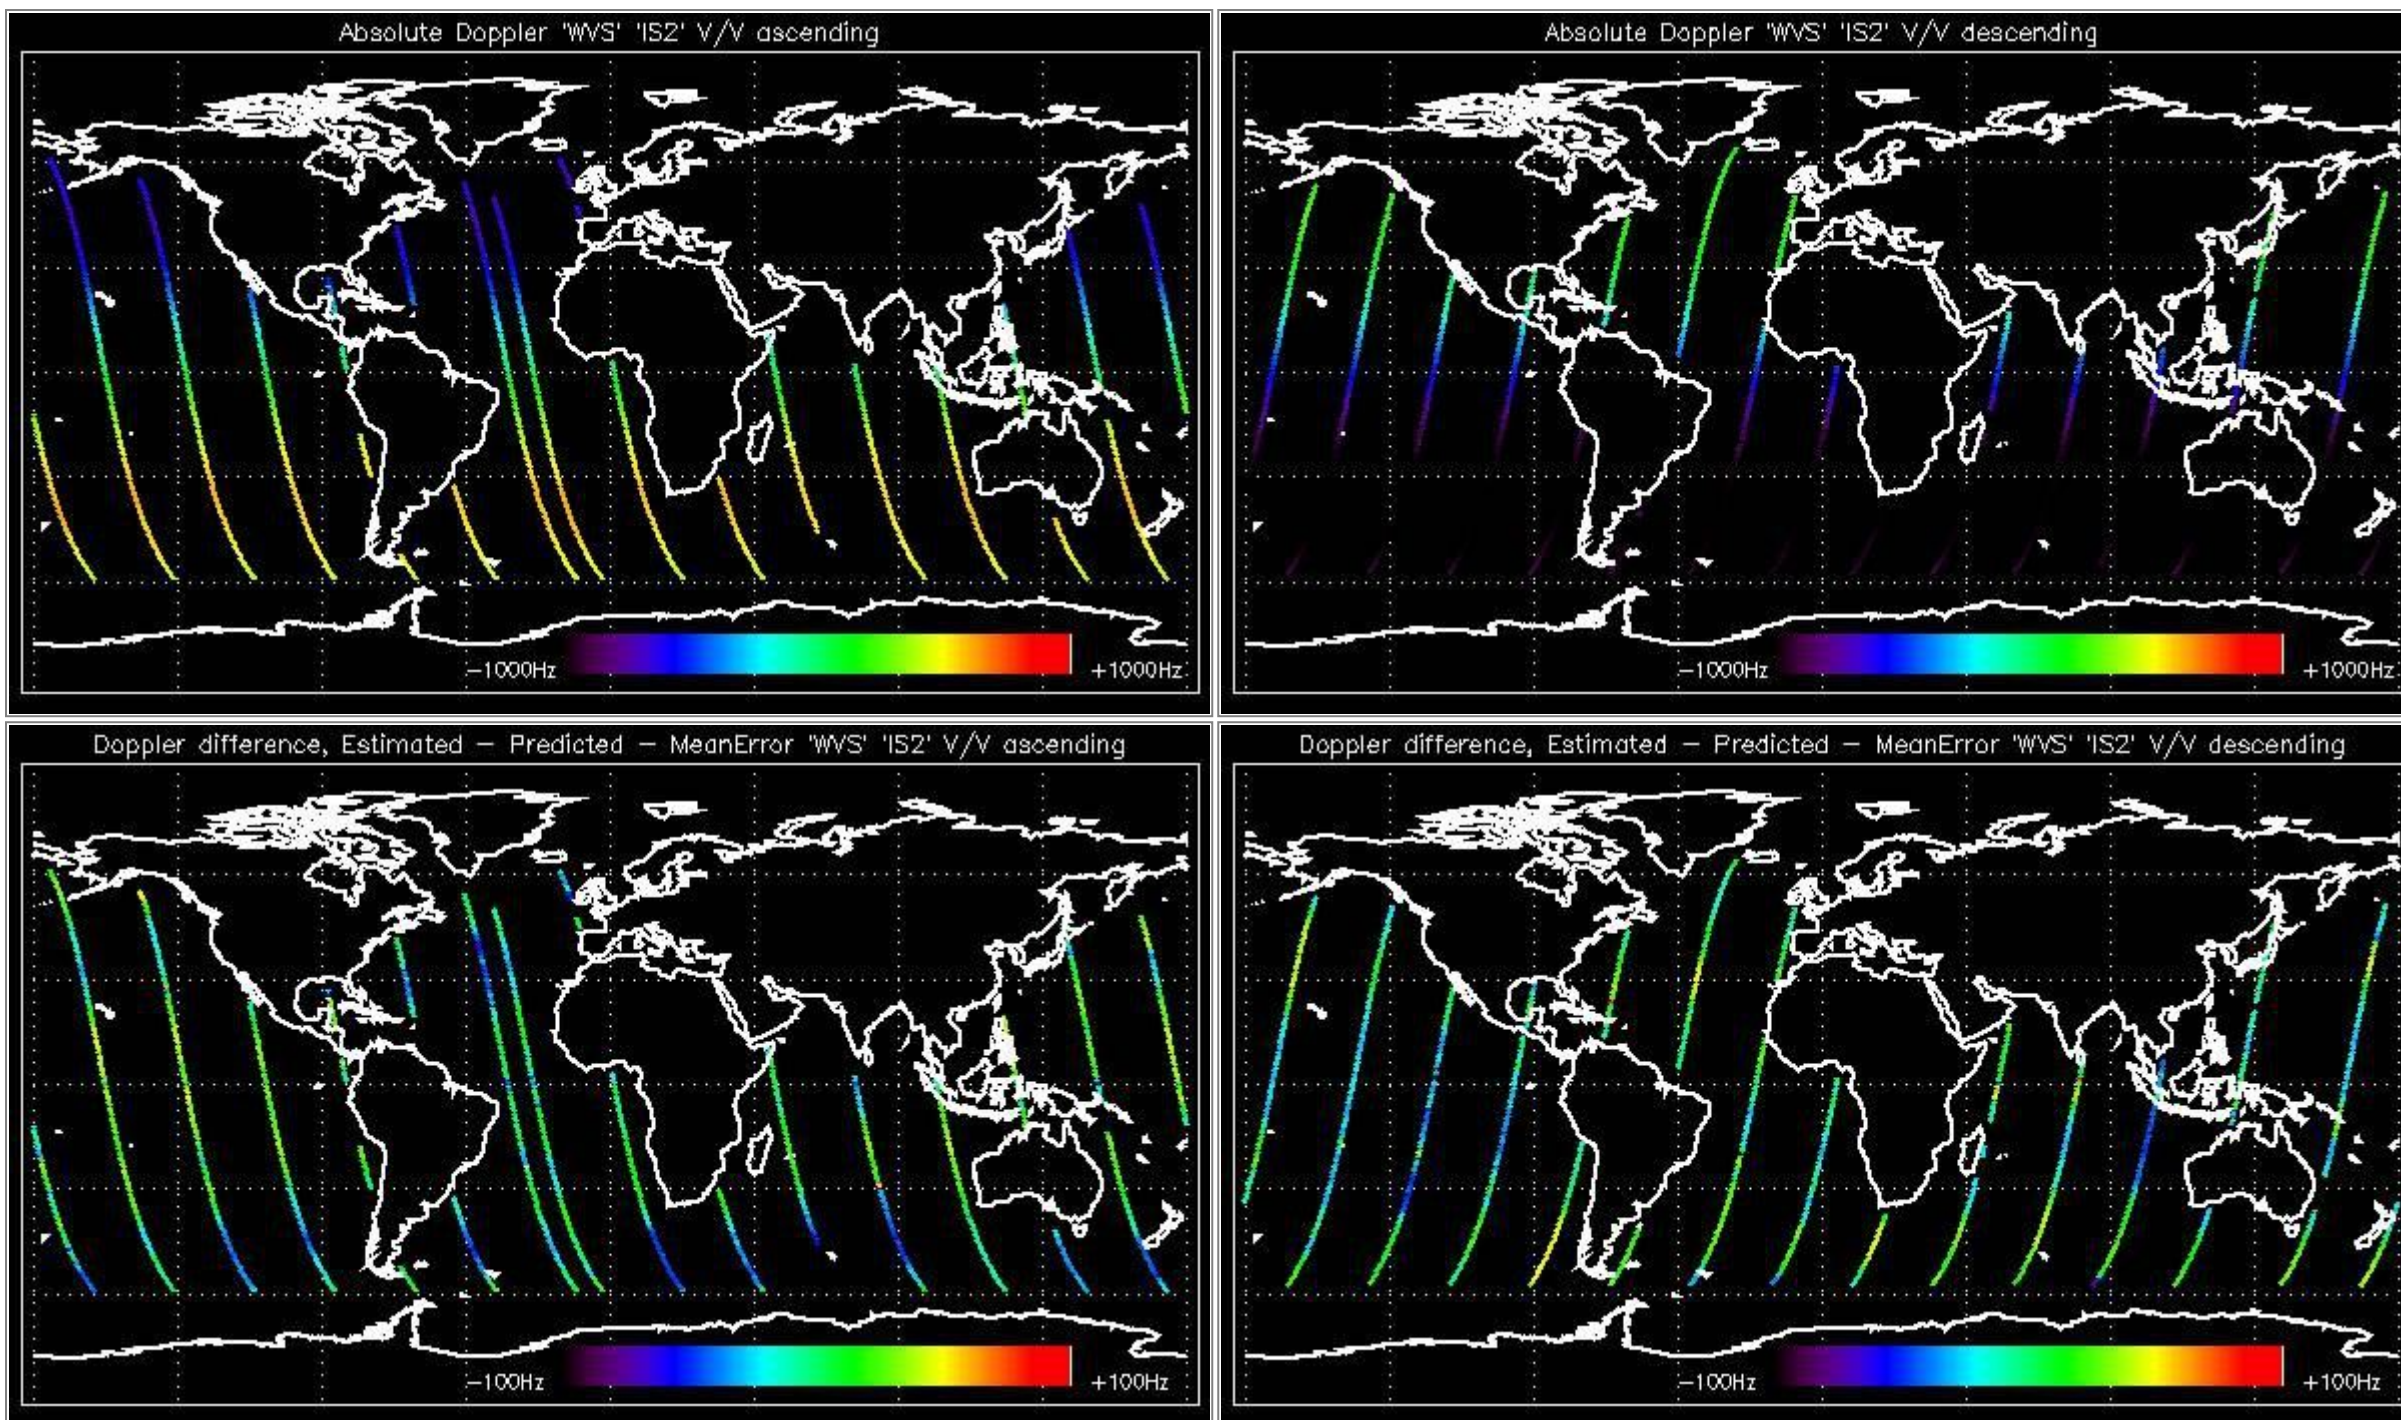

### 5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[ [BACK TO MENU](#) ]



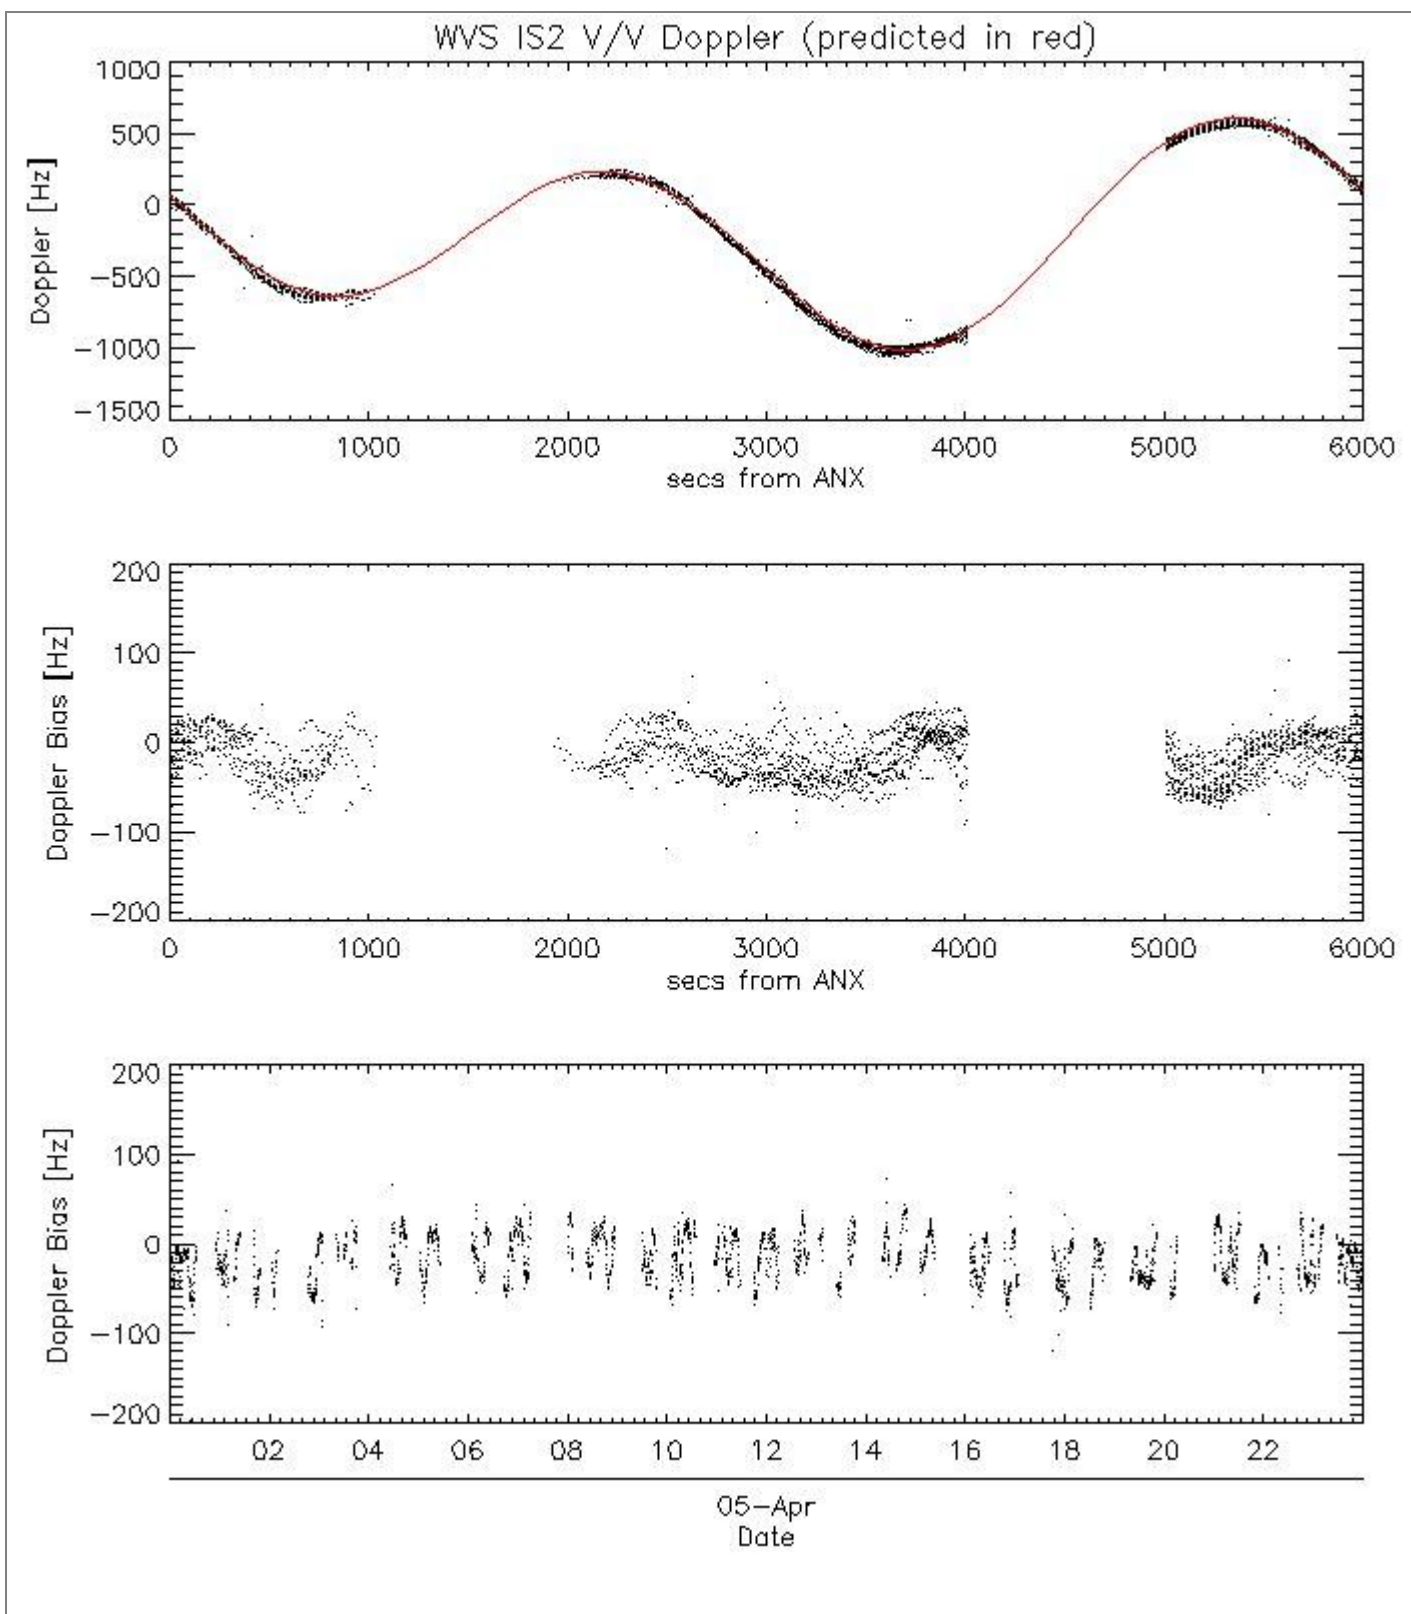


## 5.2 - Analysis for GM1 SS1 H/H

### 5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[ [BACK TO MENU](#) ]


--	--




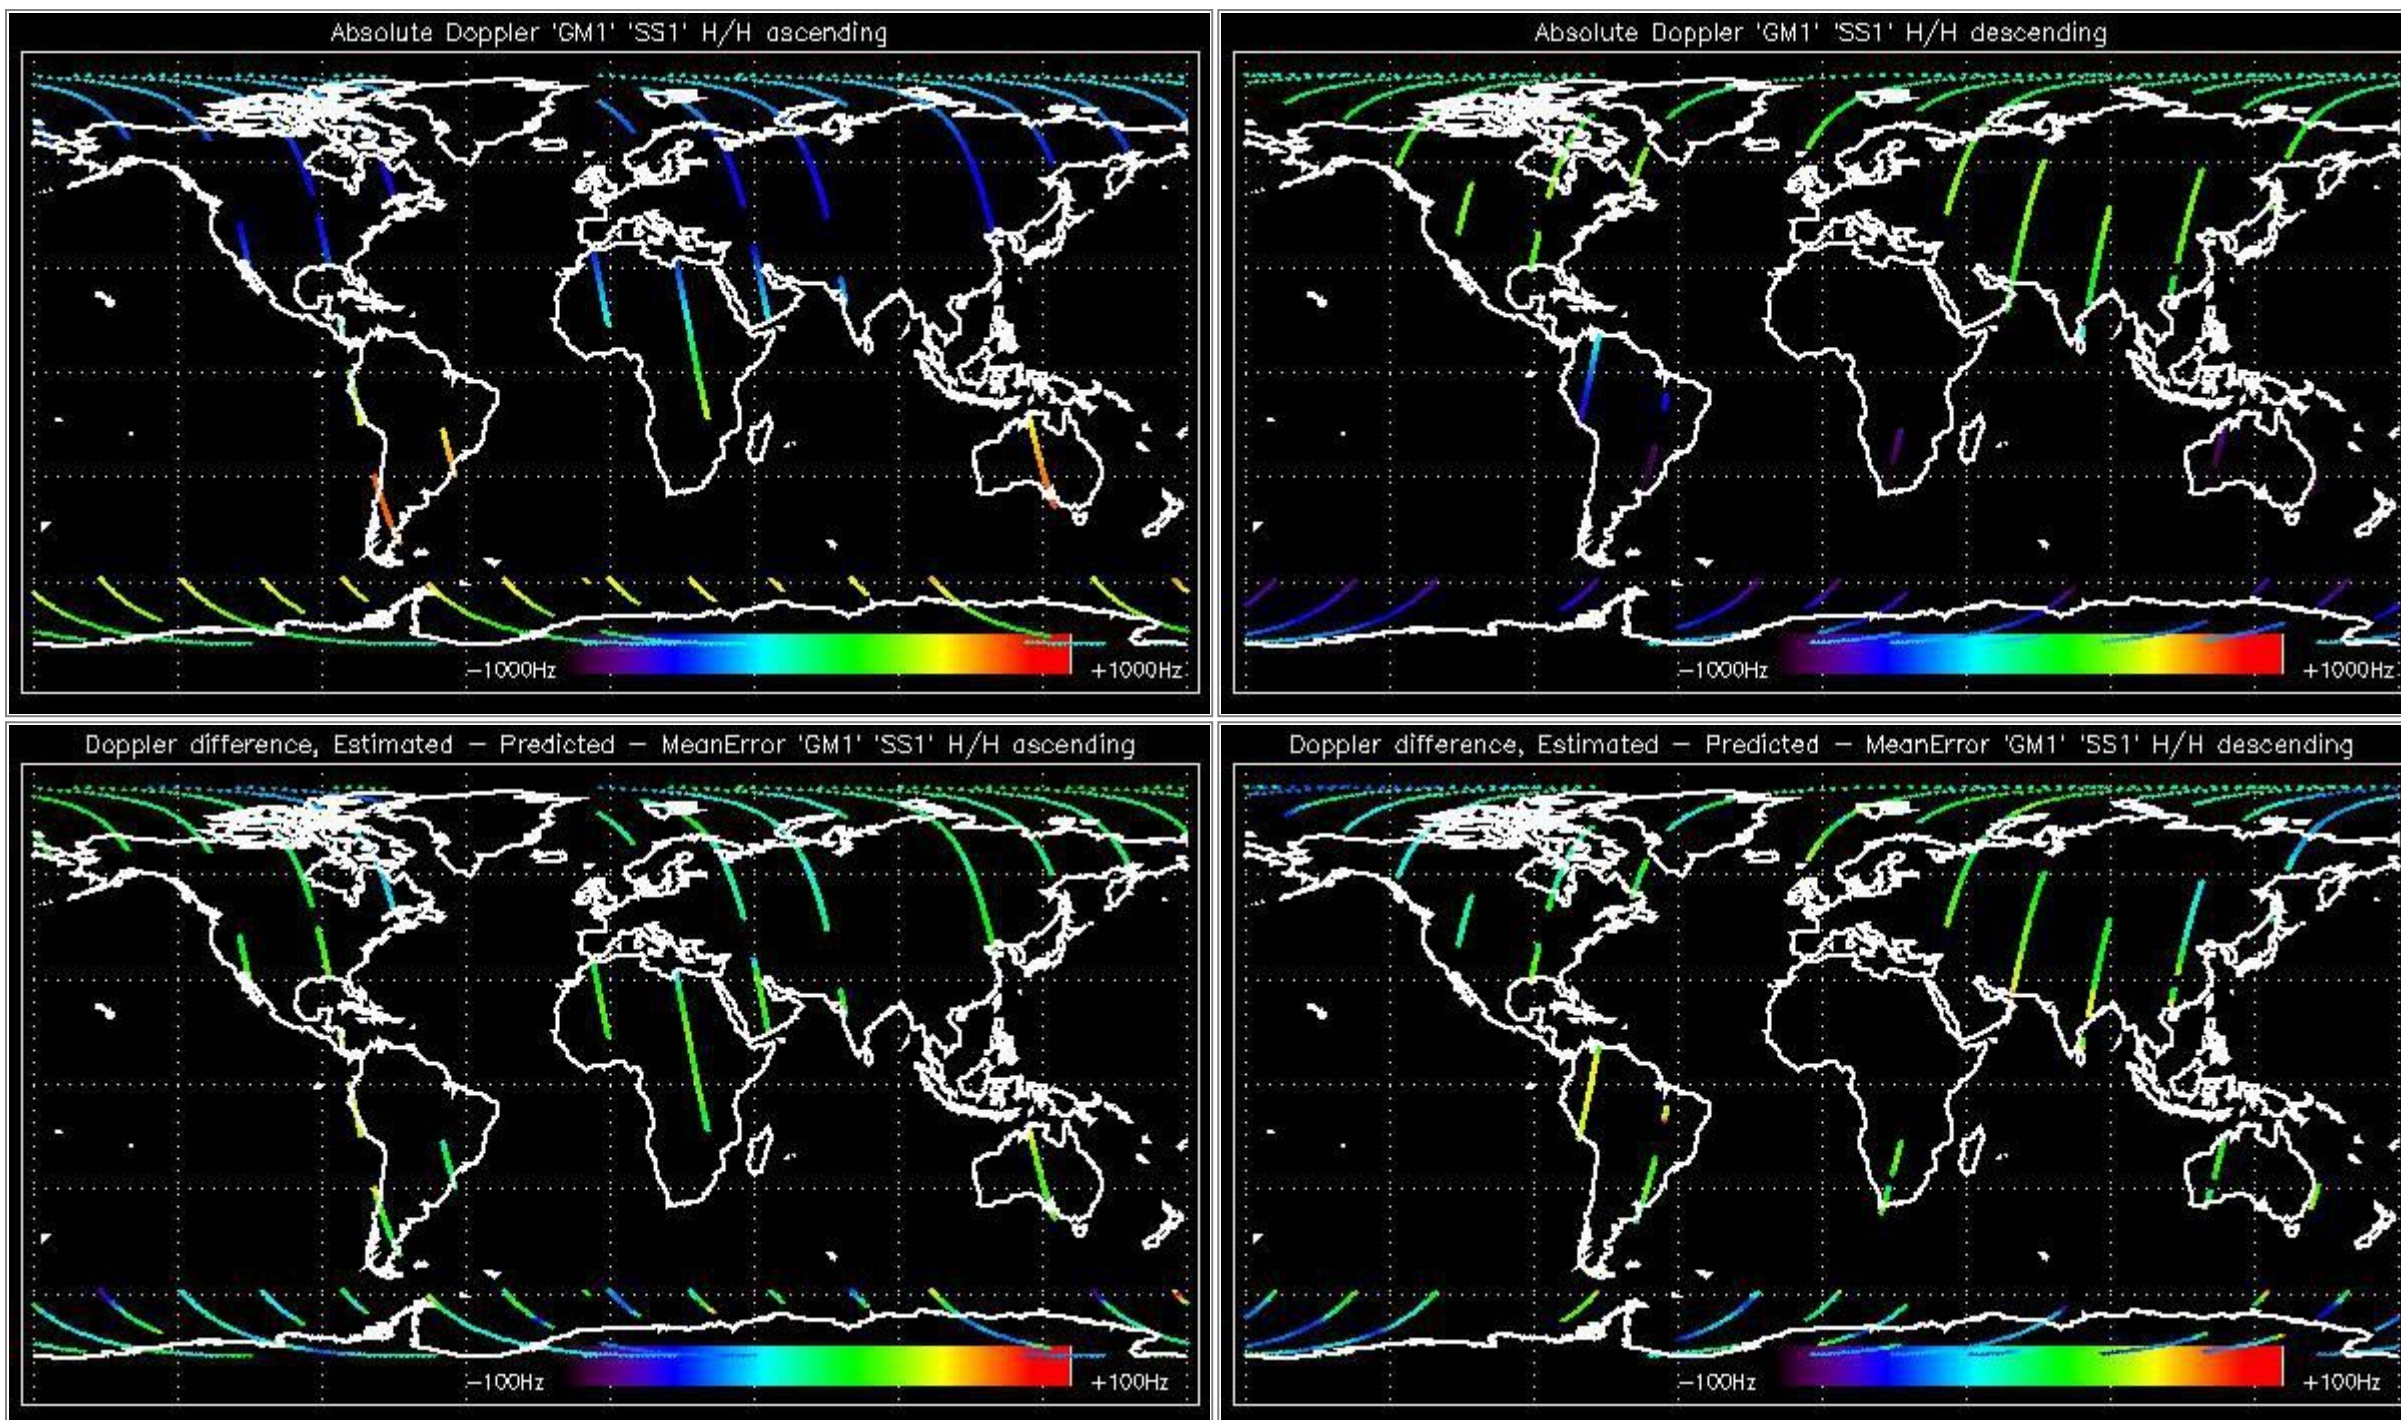

### 5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[ [BACK TO MENU](#) ]



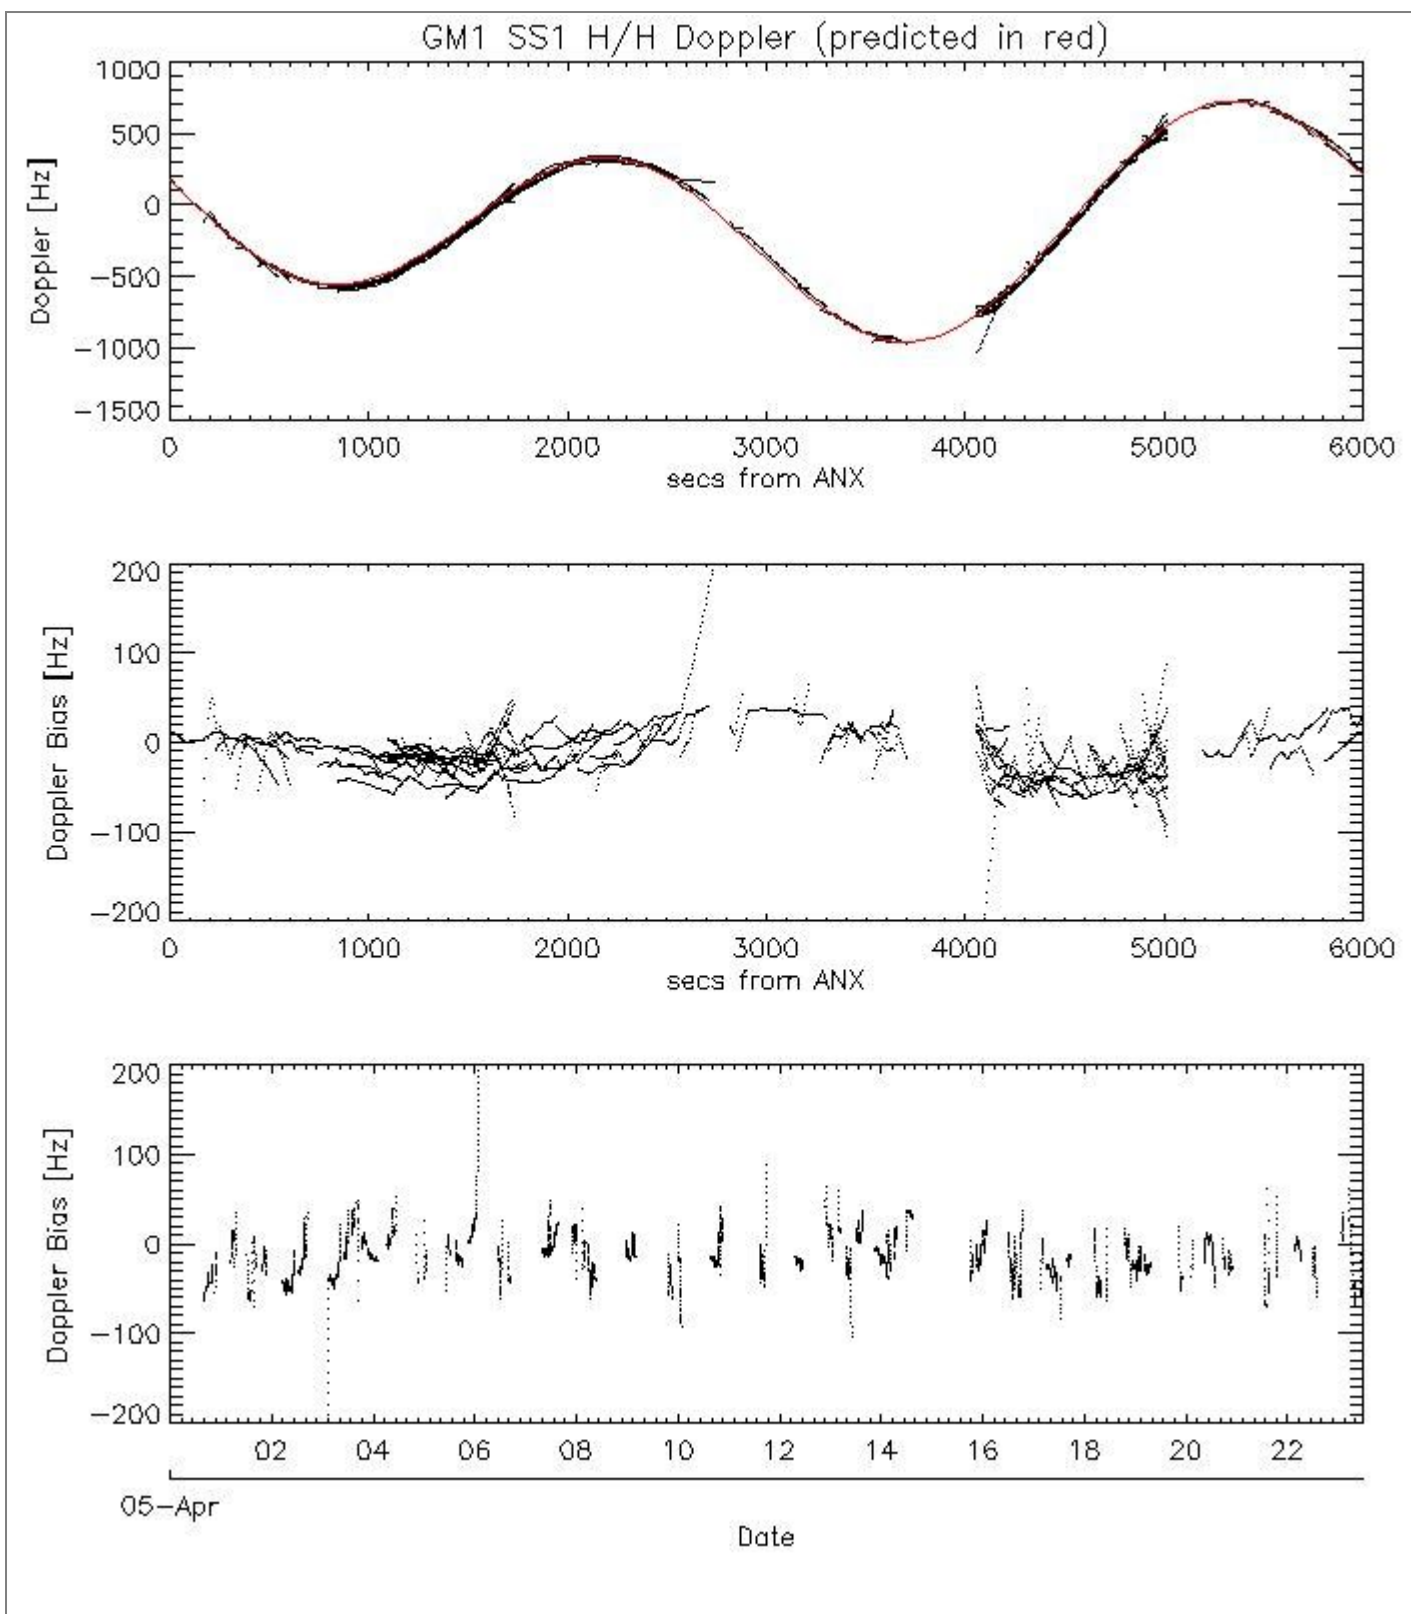


### 5.3 - Doppler JUMPS Analysis for WSM

[\[ BACK TO MENU \]](#)

--	--



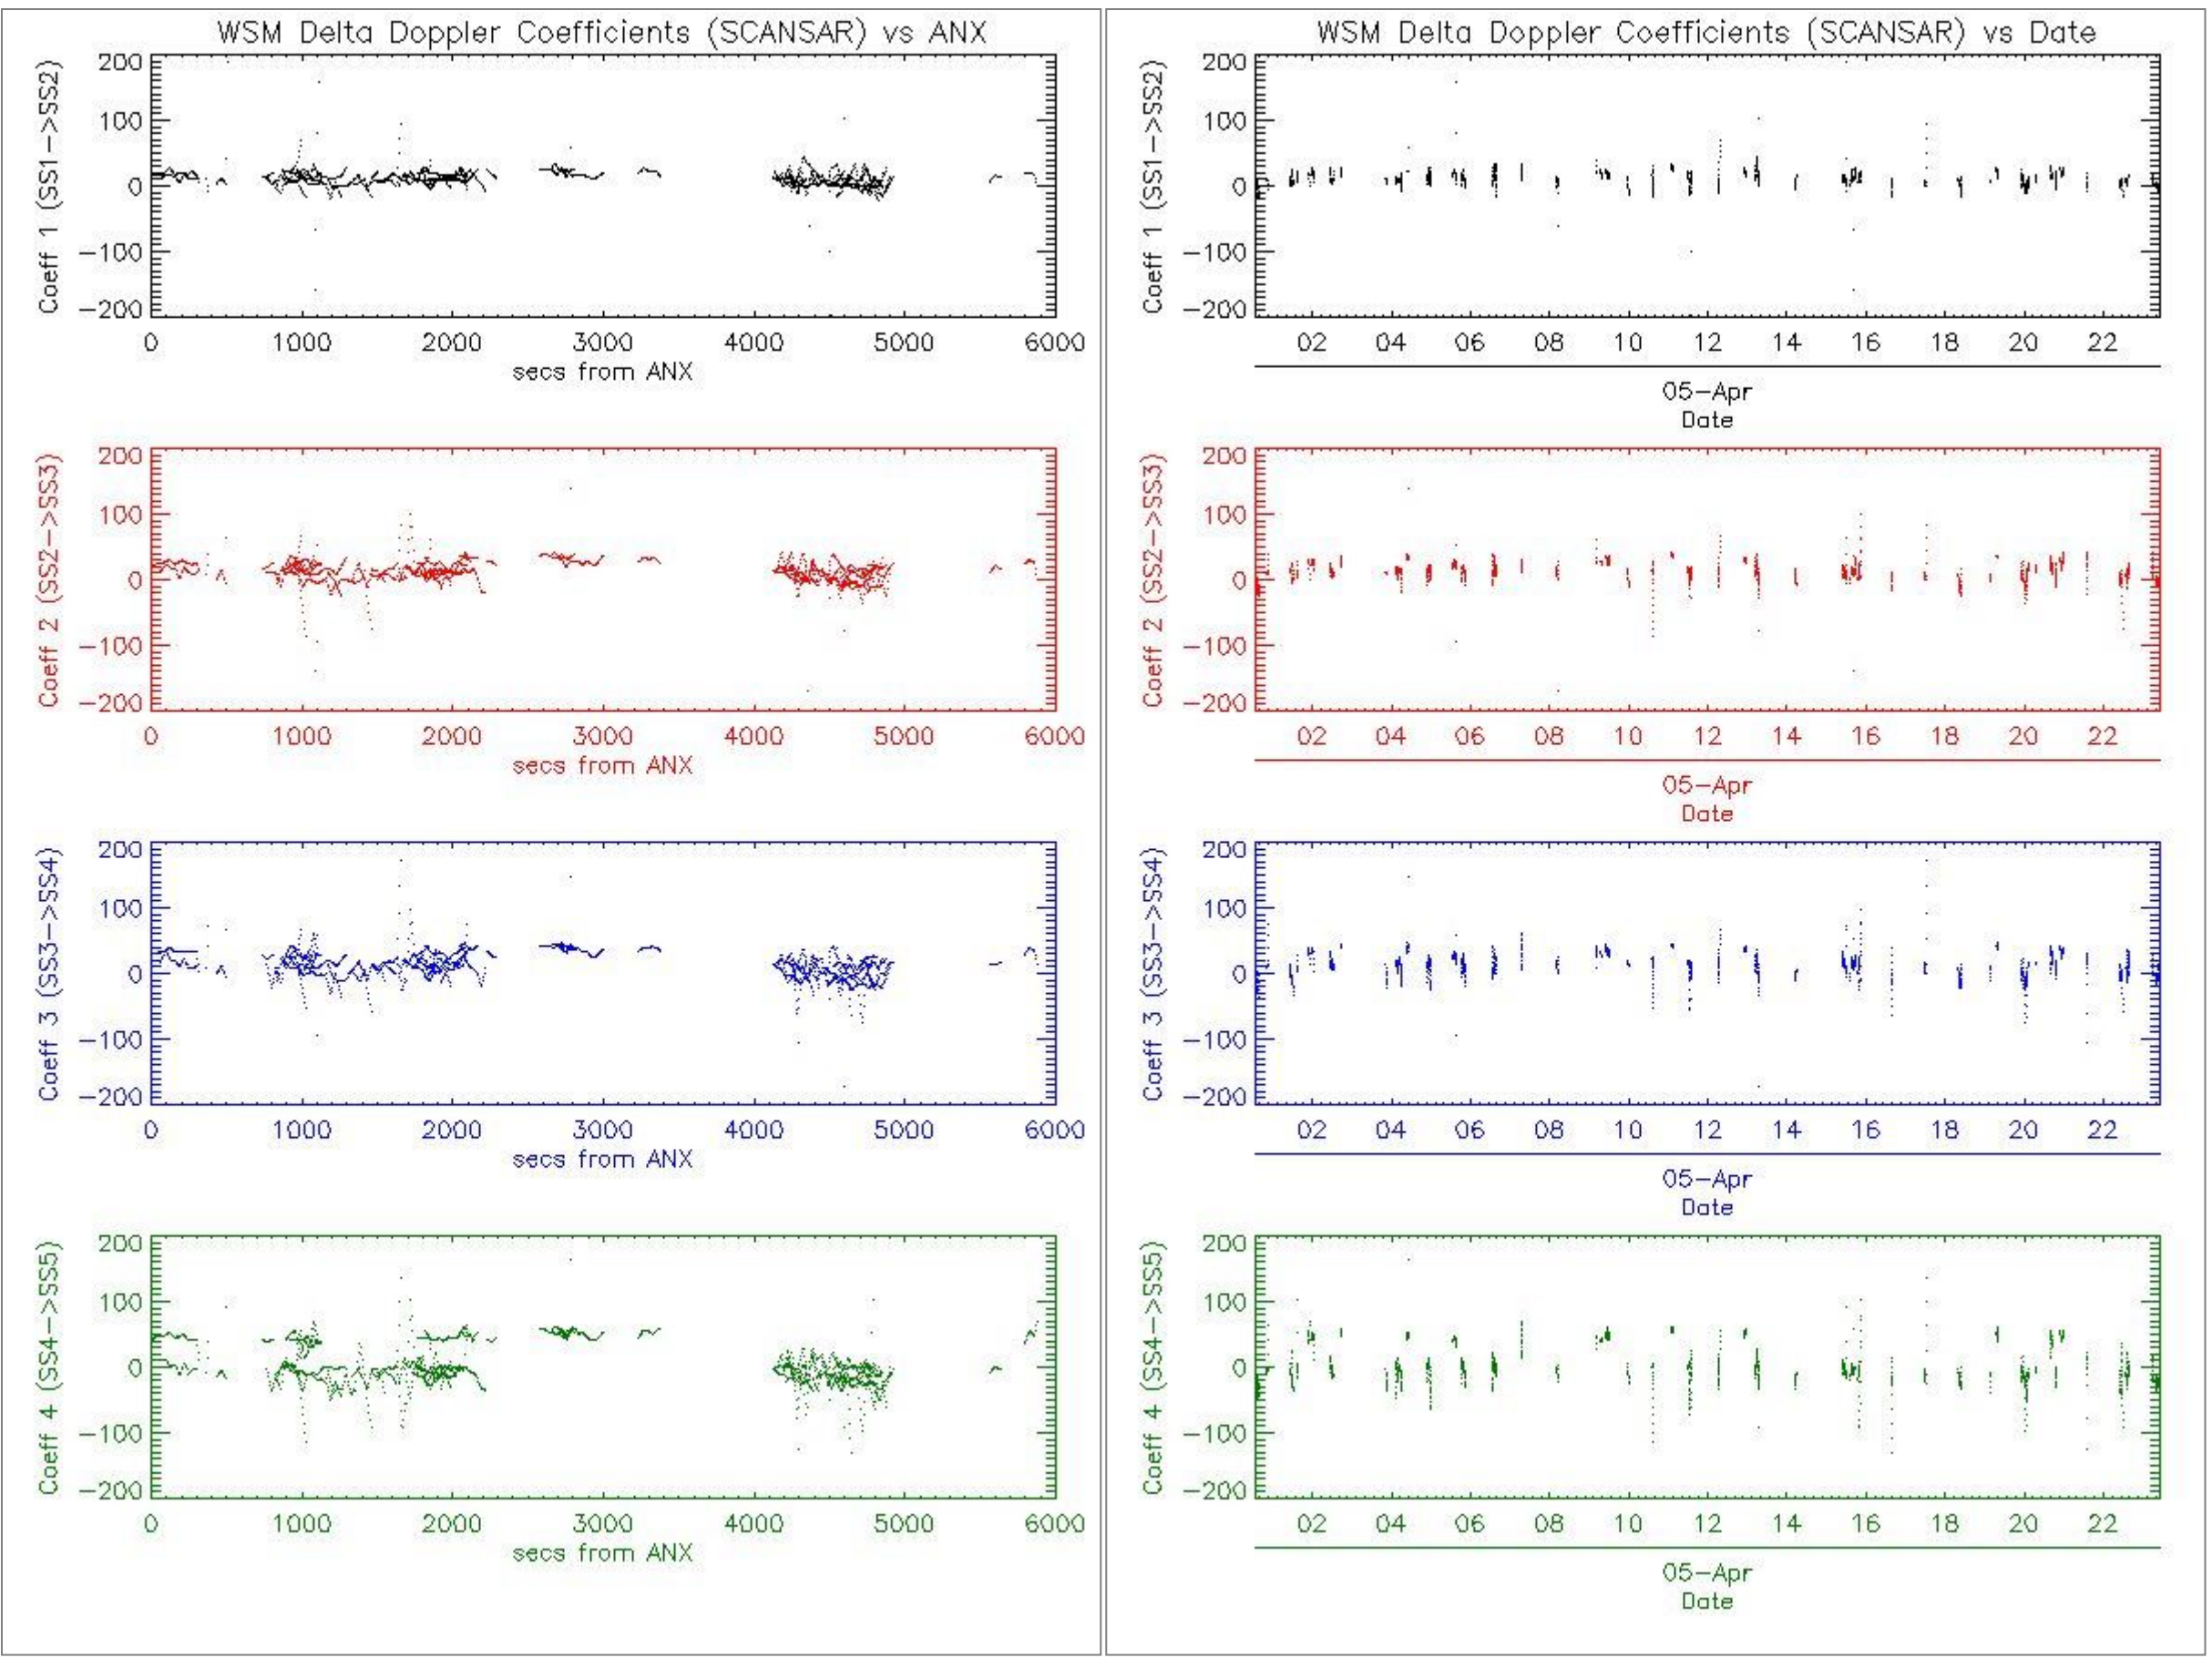


## 6 - Chirp Analysis

### 6.1 - Analysis for WSM SS1 H/H

#### 6.1.1 - ScaleFactor


[ BACK TO MENU ]

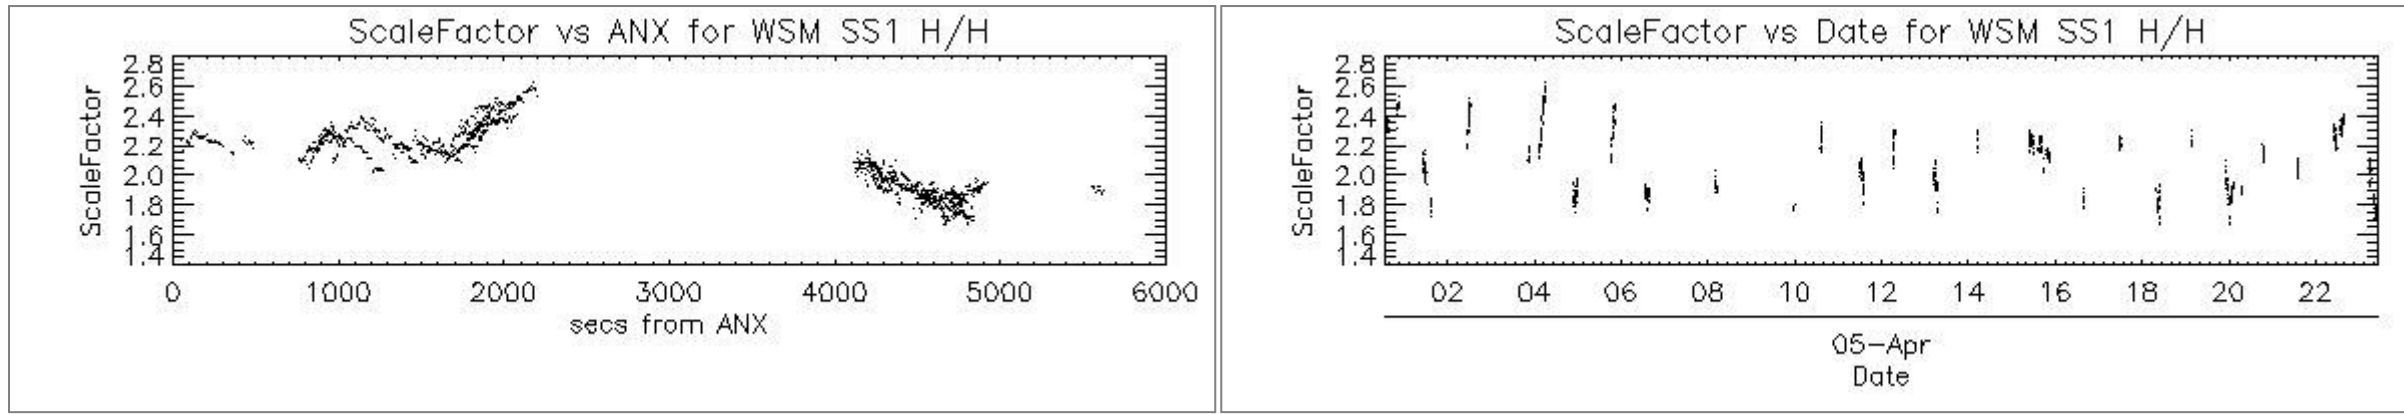

## 7 - Raw Data Analysis

### 7.1 - Analysis for WVS


[ BACK TO MENU ]

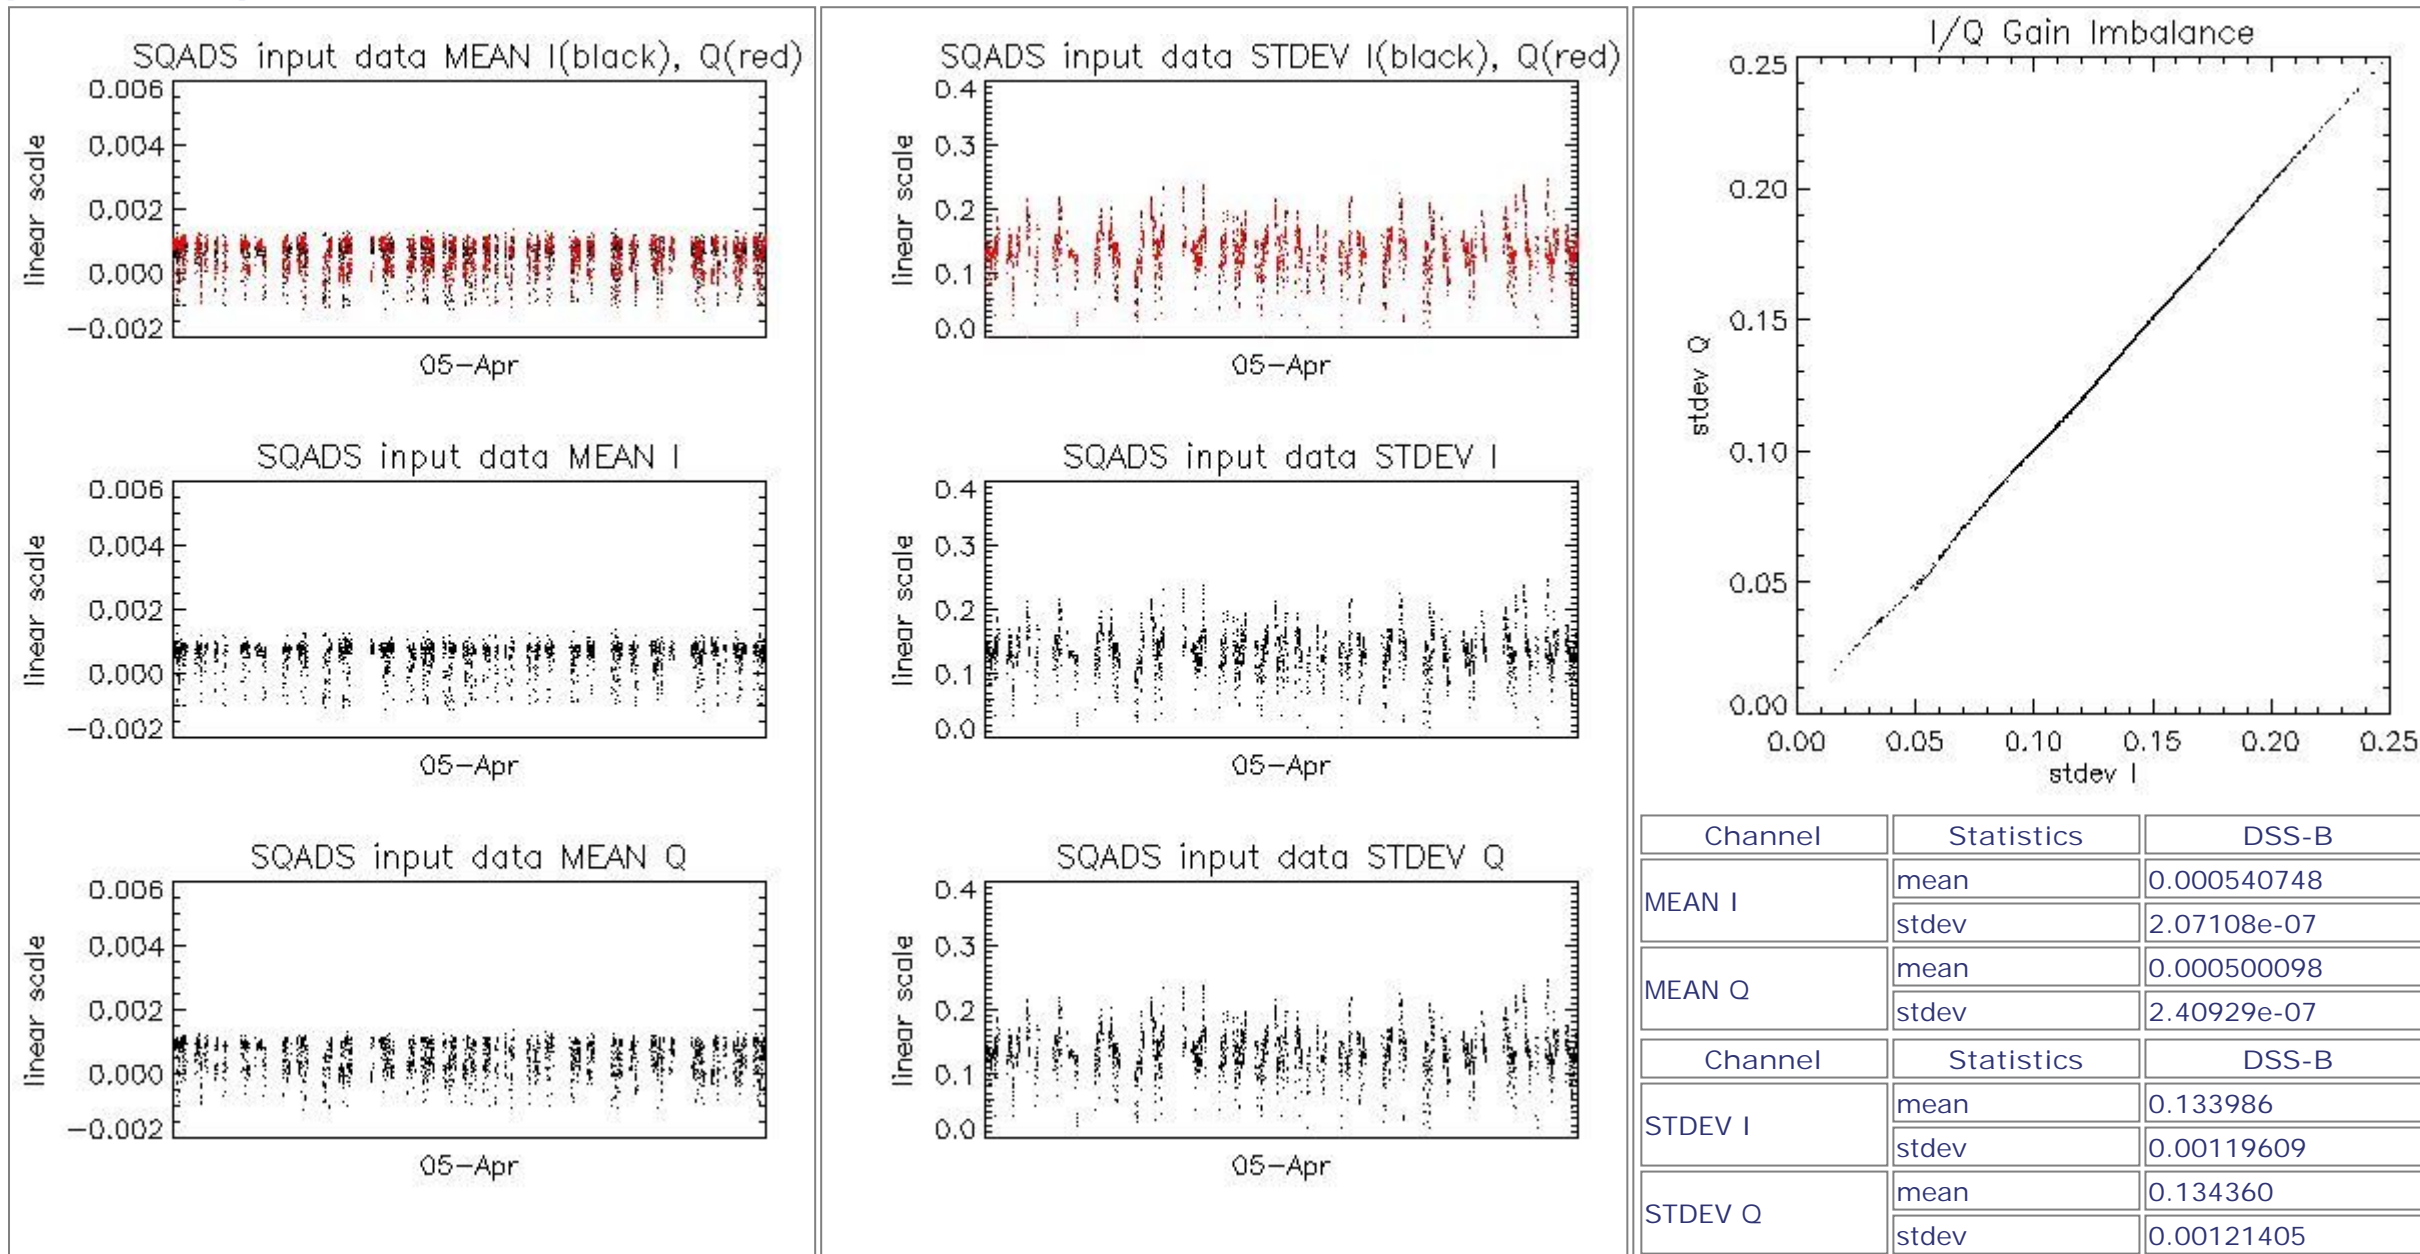

### 7.2 - Analysis for WSM

[ BACK TO MENU ]



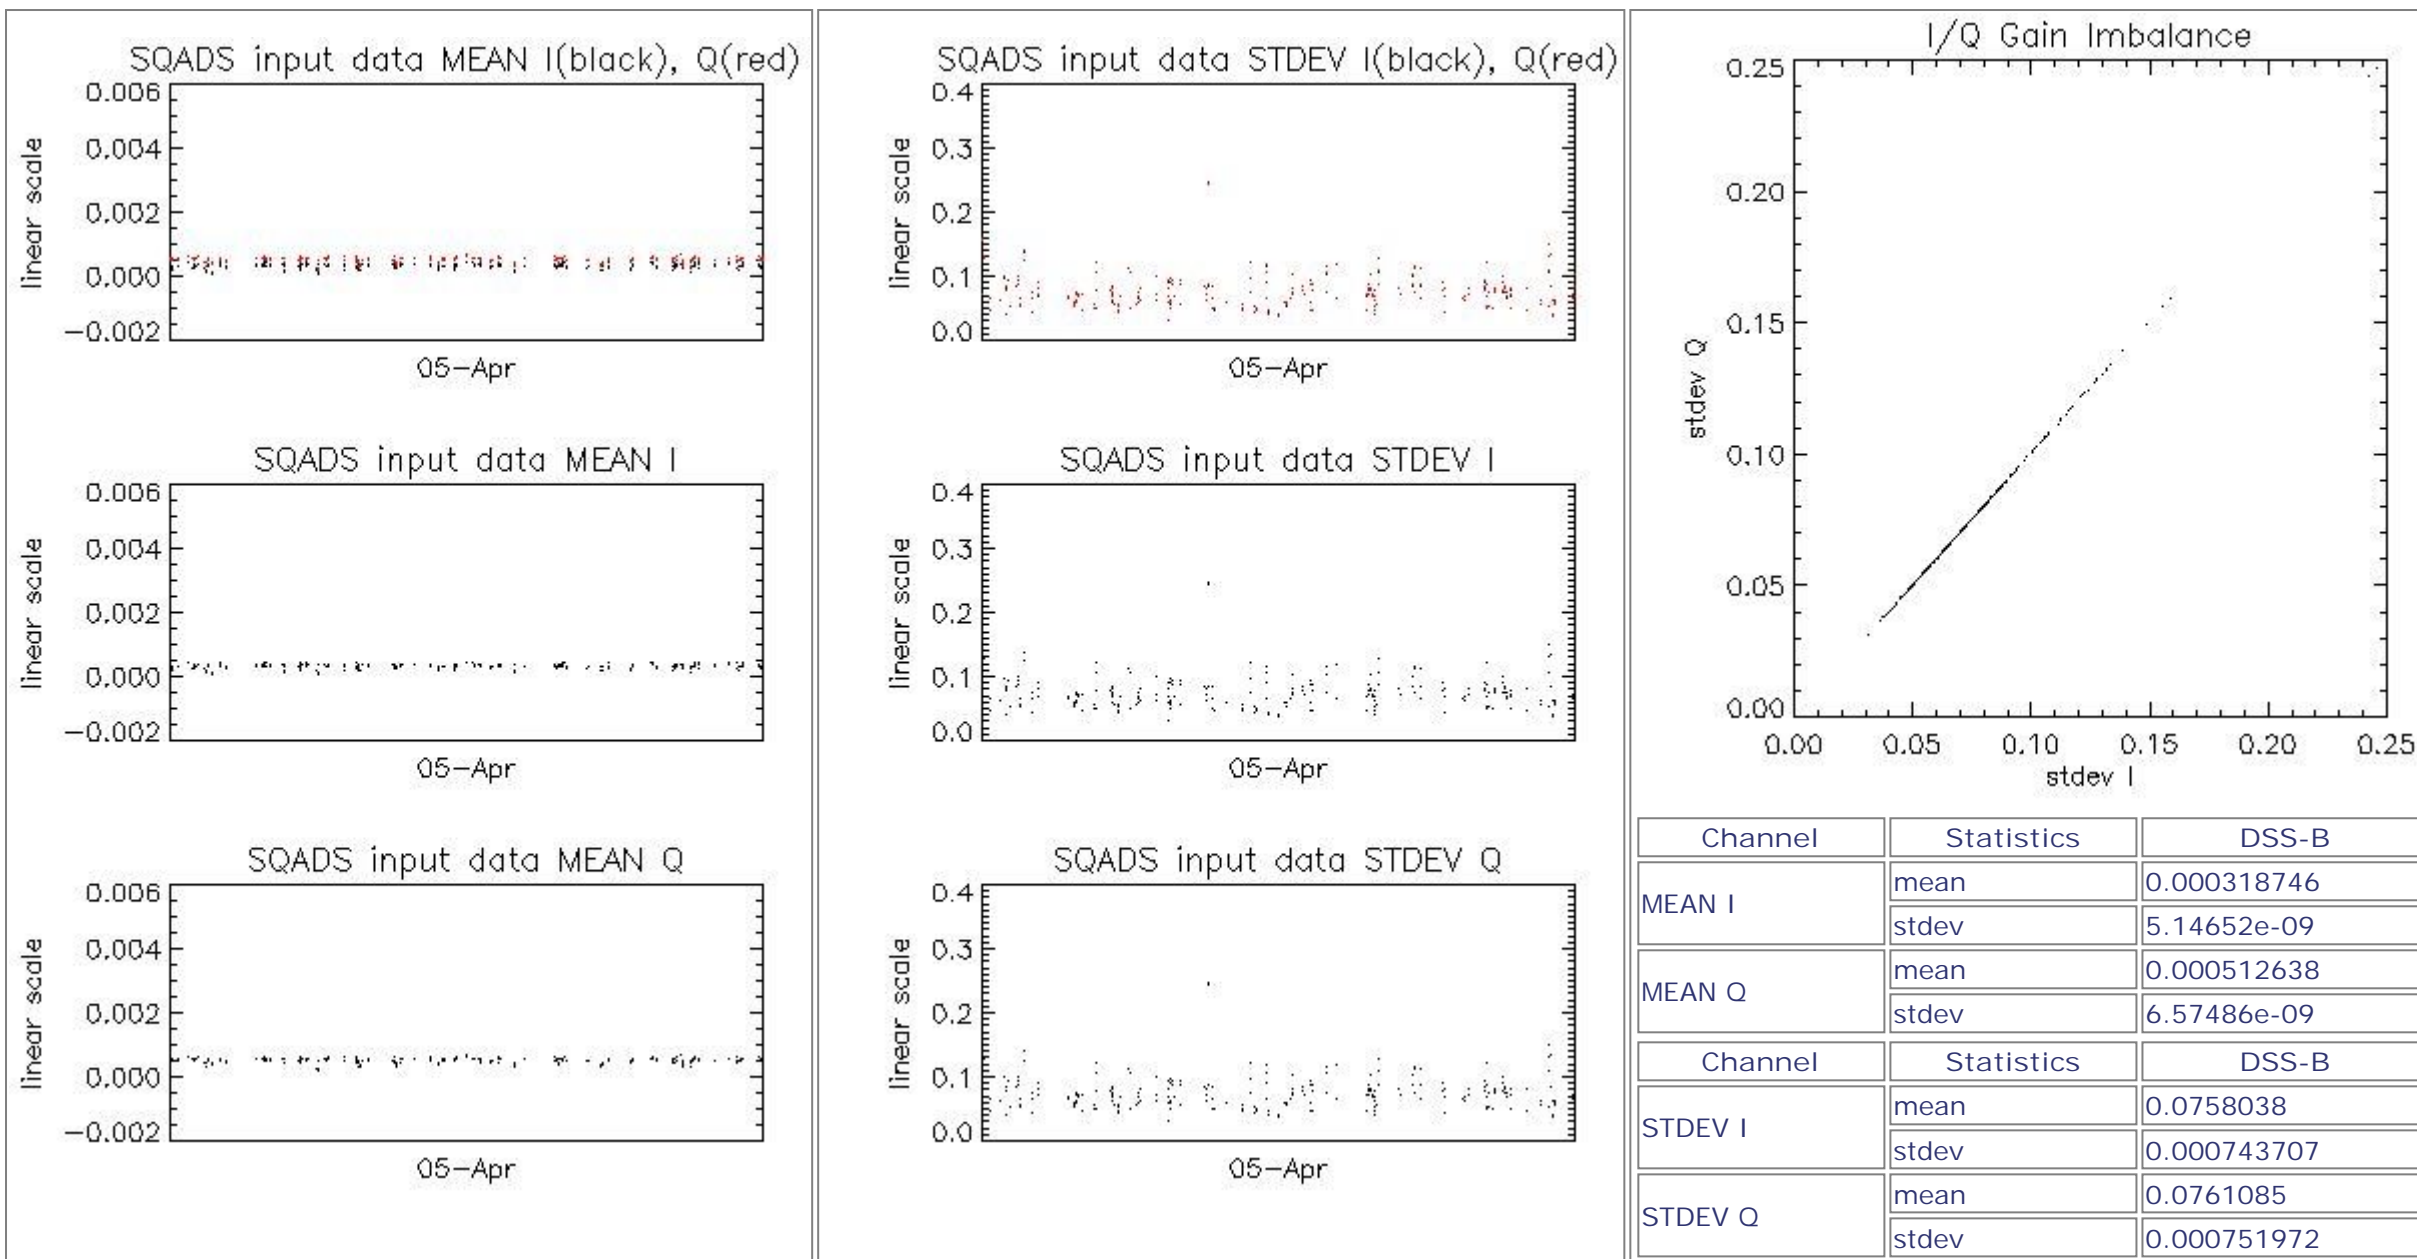



## 8 - Telemetry Analysis

Processing Center	Product	Gaps	Missing lines
PDK	ASA_GM1_1PNPDK20070405_081244_000006342057_00035_26642_7111.N1	0	13
PDK	ASA_GM1_1PNPDK20070405_181101_000005312057_00041_26648_7837.N1	0	30
PDK	ASA_GM1_1PNPDK20070405_195137_000002172057_00042_26649_7949.N1	0	12
PDE	ASA_WSM_1PNPDE20070405_091731_000000672057_00036_26643_9932.N1	0	1

### 8.1 - Number of Missing lines


[ BACK TO MENU ]



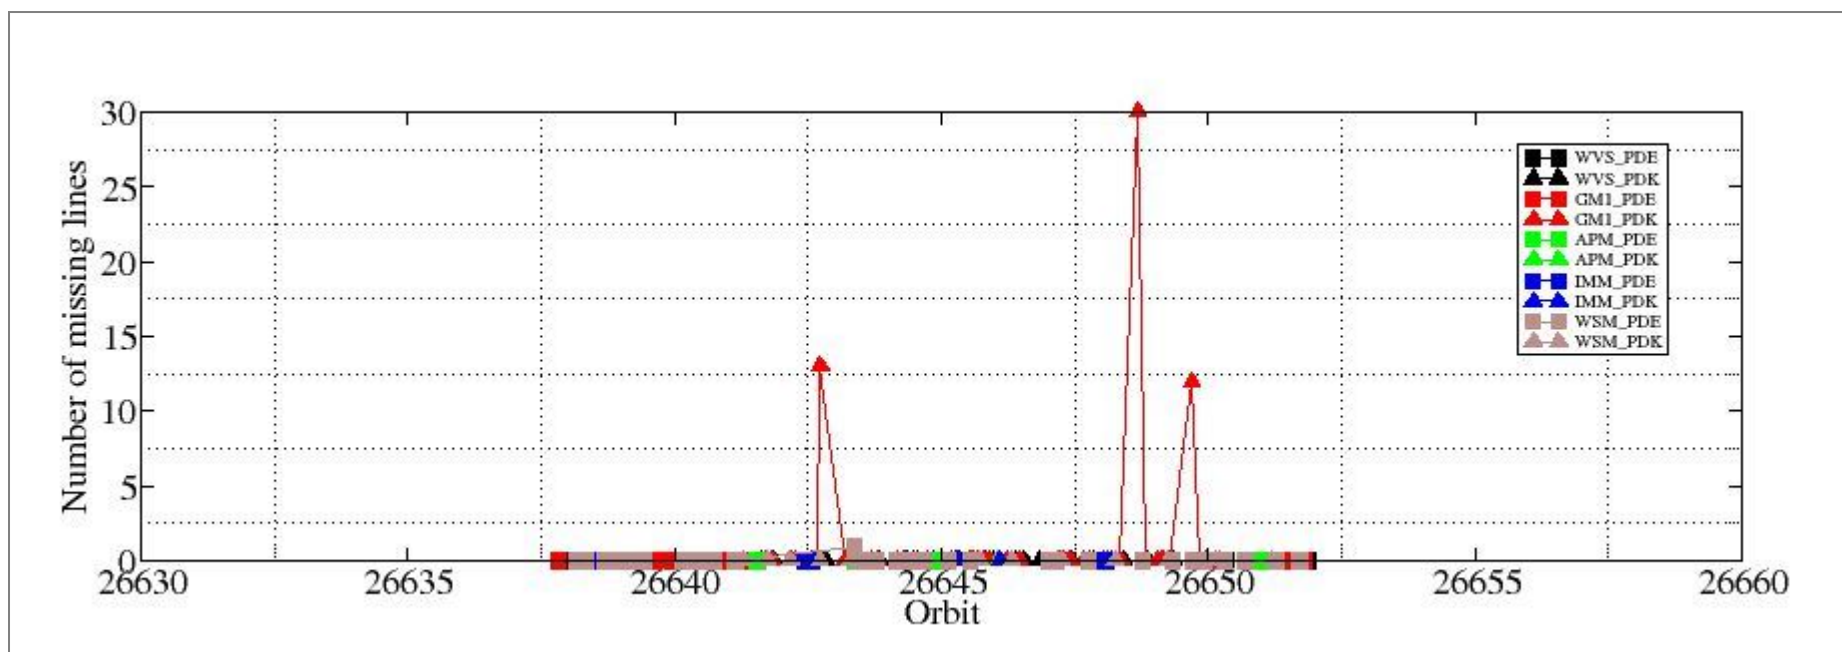

## 8.2 - Number of Gaps

[\[ BACK TO MENU \]](#)

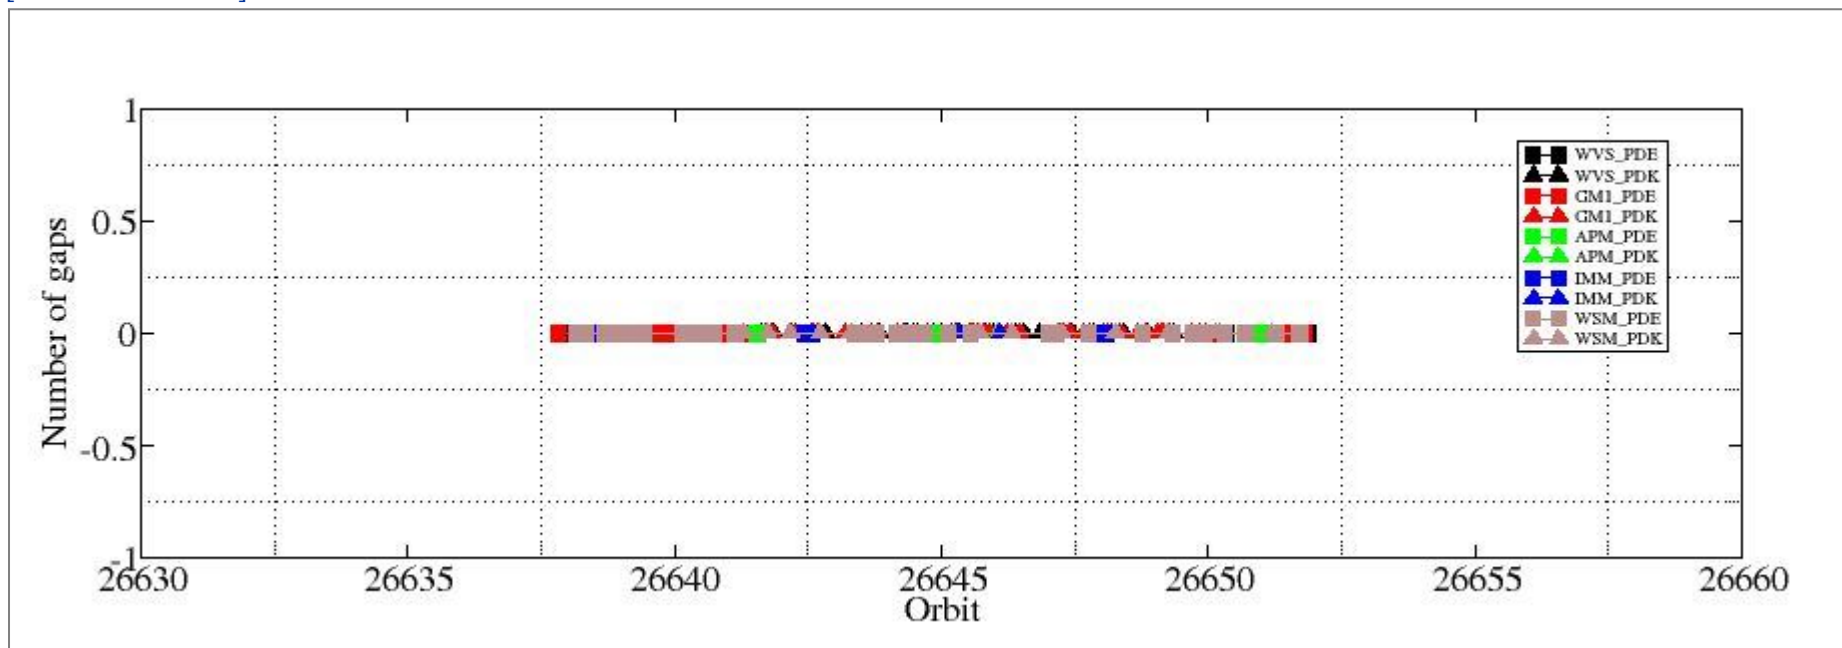



#####  
ASAR DAILY REPORT for 070405  
#####

MODE: DAILY  
ANALYSIS: ALL  
DATE: YESTERDAY

Analysis will be performed from 2007-04-05 00:00:00 to 2007-04-05 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/070405/

DATA SUMMARY

#####  
Summary will be performed from 2007-04-05 00:00:00 to 2007-04-05 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/070405/DATA\_SUMMARY

Creating directory ./RESULTS/DAILY/070405/DATA\_SUMMARY...  
Writing file ./RESULTS/DAILY/070405/DATA\_SUMMARY/Data\_summary.html...

\*\*\*\*\*  
Getting WVS products list from 2007-04-05 00:00:00 to 2007-04-05 23:59:59...  
Writing file ./RESULTS/DAILY/070405/DATA\_SUMMARY/List\_WVS\_products\_used.xls...  
Writing file ./RESULTS/DAILY/070405/DATA\_SUMMARY/List\_WVS\_products\_used.txt...

\*\*\*\*\*  
Getting GM1 products list from 2007-04-05 00:00:00 to 2007-04-05 23:59:59...  
Writing file ./RESULTS/DAILY/070405/DATA\_SUMMARY/List\_GM1\_products\_used.xls...  
Writing file ./RESULTS/DAILY/070405/DATA\_SUMMARY/List\_GM1\_products\_used.txt...

\*\*\*\*\*  
Getting APM products list from 2007-04-05 00:00:00 to 2007-04-05 23:59:59...  
Writing file ./RESULTS/DAILY/070405/DATA\_SUMMARY/List\_APM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/070405/DATA\_SUMMARY/List\_APM\_products\_used.txt...

\*\*\*\*\*  
Getting IMM products list from 2007-04-05 00:00:00 to 2007-04-05 23:59:59...  
Writing file ./RESULTS/DAILY/070405/DATA\_SUMMARY/List\_IMM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/070405/DATA\_SUMMARY/List\_IMM\_products\_used.txt...

\*\*\*\*\*  
Getting WSM products list from 2007-04-05 00:00:00 to 2007-04-05 23:59:59...  
Writing file ./RESULTS/DAILY/070405/DATA\_SUMMARY/List\_WSM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/070405/DATA\_SUMMARY/List\_WSM\_products\_used.txt...

\*\*\*\*\*  
Getting MS products list from 2007-04-05 00:00:00 to 2007-04-05 23:59:59...  
Writing file ./RESULTS/DAILY/070405/DATA\_SUMMARY/List\_MS\_products\_used.xls...  
Writing file ./RESULTS/DAILY/070405/DATA\_SUMMARY/List\_MS\_products\_used.txt...

DATA SUMMARY completed  
#####

AUXILIARY FILES ANALYSIS

#####  
Analysis will be performed from 2007-04-05 00:00:00 to 2007-04-05 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/070405/AUXILIARY

Creating directory ./RESULTS/DAILY/070405/AUXILIARY...

\*\*\*\*\*  
Looking for the IECF operational ADFs list...



Found list 20070405\_030002\_current\_3\_IECF\_ADFs.txt...  
Extracting ADFs...

ASA\_CON\_AXVIEC20070222\_190441\_20070204\_165113\_20071231\_000000  
ASA\_INS\_AXVIEC20070306\_164819\_20070307\_060000\_20071231\_000000  
ASA\_XCH\_AXVIEC20051219\_162547\_20020301\_000000\_20081231\_000000  
ASA\_XCA\_AXVIEC20070222\_185842\_20070204\_165113\_20071231\_000000

Writing file ./RESULTS/DAILY/070405/AUXILIARY/ASAR\_ADFs\_IECF\_List3.html...  
Writing file ./RESULTS/DAILY/070405/AUXILIARY/Auxiliary\_files\_summary.html...

\*\*\*\*\*  
Analysing WVS products...

Writing file ./RESULTS/DAILY/070405/AUXILIARY/Check\_ADFs\_WVS.xls...  
Writing file ./RESULTS/DAILY/070405/AUXILIARY/Check\_ADFs\_WVS.txt...

ASA_WVS_1PNPDE20070405_000024_000003292057_00030_26637_9147.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_000509_000016492057_00030_26637_9193.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_005455_000009652057_00031_26638_9200.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_011802_000003752057_00031_26638_9205.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_014100_000002092057_00031_26638_9218.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_014330_000003152057_00031_26638_9345.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_020323_000003742057_00032_26639_9356.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_024639_000007042057_00032_26639_9368.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_025809_000004052057_00032_26639_9504.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_032136_000001202057_00032_26639_9497.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_033010_000001942057_00032_26639_9494.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_033846_000001042057_00033_26640_9511.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_034301_000001792057_00033_26640_9530.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_042637_000008092057_00033_26640_9536.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_043952_000003302057_00033_26640_9742.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_050212_000014092057_00033_26640_9787.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_060451_000004642057_00034_26641_9765.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_061439_000000442057_00034_26641_9758.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_061717_000001952057_00034_26641_9755.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_025958_000018892057_00043_26650_0239.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_214812_000003152057_00043_26650_0236.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_215242_000007942057_00043_26650_0357.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_221745_000000442057_00044_26651_0354.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_222003_000001352057_00044_26651_0360.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_224114_000013042057_00044_26651_0369.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_230556_000003602057_00044_26651_0376.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_232847_000003152057_00044_26651_0379.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20070405_233318_000017242057_00044_26651_0498.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_062017_000003452057_00034_26641_7017.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_064247_000019492057_00034_26641_7041.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_080055_000003452057_00035_26642_7109.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_082323_000020542057_00035_26642_7193.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_093024_000010042057_00036_26643_7246.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_100359_000018292057_00036_26643_7305.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_105717_000003442057_00037_26644_7346.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_110748_000005542057_00037_26644_7349.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_111718_000006302057_00037_26644_7354.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_114435_000007802057_00037_26644_7359.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_120008_000008542057_00037_26644_7390.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_123355_000010042057_00038_26645_7441.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_130324_000002992057_00038_26645_7446.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_132511_000003002057_00038_26645_7453.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_133842_000005242057_00038_26645_7461.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_142017_000005092057_00039_26646_7578.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_143717_000007052057_00039_26646_7583.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_150547_000010342057_00039_26646_7590.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_160515_000014542057_00040_26647_7724.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_164624_000010492057_00040_26647_7736.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20070405_174507_000014992057_00041_26648_7840.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK





ASA\_WVS\_1PNPDK20070405\_183102\_000009742057\_00041\_26648\_7845.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_WVS\_1PNPDK20070405\_192009\_000018442057\_00042\_26649\_7954.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_WVS\_1PNPDK20070405\_200736\_000004952057\_00042\_26649\_7963.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK

\*\*\*\*\*

Analysing GM1 products...

Writing file ./RESULTS/DAILY/070405/AUXILIARY/Check\_ADFs\_GM1.xls...

Writing file ./RESULTS/DAILY/070405/AUXILIARY/Check\_ADFs\_GM1.txt...

ASA\_GM1\_1PNPDE20070405\_004026\_000006102057\_00031\_26638\_9190.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_005307\_000001022057\_00031\_26638\_9195.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_011153\_000002232057\_00031\_26638\_9197.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_011632\_00000902057\_00031\_26638\_9202.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_013052\_000002892057\_00031\_26638\_9207.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_013727\_000002112057\_00031\_26638\_9209.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_014933\_000002232057\_00031\_26638\_9347.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_021202\_000009002057\_00032\_26639\_9349.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_023208\_000004532057\_00032\_26639\_9358.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_024047\_000000782057\_00032\_26639\_9372.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_030537\_000009242057\_00032\_26639\_9506.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_032431\_000003382057\_00032\_26639\_9501.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_033417\_000002652057\_00032\_26639\_9499.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_034121\_000000962057\_00033\_26640\_9513.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_034657\_000002532057\_00033\_26640\_9508.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_035252\_000008092057\_00033\_26640\_9527.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_041551\_000004712057\_00033\_26640\_9532.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_042527\_000000662057\_00033\_26640\_9543.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_045131\_000001382057\_00033\_26640\_9739.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_050005\_000001262057\_00033\_26640\_9752.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_052633\_000002772057\_00034\_26641\_9762.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_053756\_000005012057\_00034\_26641\_9760.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_055234\_000007372057\_00034\_26641\_9784.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_204400\_000001572057\_00043\_26650\_0223.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_204946\_000002892057\_00043\_26650\_0231.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_213213\_000001382057\_00043\_26650\_0227.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_213619\_000001382057\_00043\_26650\_0229.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_214604\_000001262057\_00043\_26650\_0233.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_220854\_000003742057\_00044\_26651\_0362.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_222941\_000002472057\_00044\_26651\_0364.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_230352\_000001202057\_00044\_26651\_0366.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_231249\_000000722057\_00044\_26651\_0371.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_231645\_000001752057\_00044\_26651\_0373.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDE20070405\_232623\_000001442057\_00044\_26651\_0386.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_062805\_000002412057\_00034\_26641\_7014.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_063937\_000001872057\_00034\_26641\_7019.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_071842\_000005862057\_00035\_26642\_7033.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_072747\_000005862057\_00035\_26642\_7095.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_075457\_000001692057\_00035\_26642\_7097.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_075841\_000001322057\_00035\_26642\_7099.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_080725\_000001572057\_00035\_26642\_7101.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_081244\_000006342057\_00035\_26642\_7111.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_085835\_000006642057\_00036\_26643\_7178.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_094801\_000002832057\_00036\_26643\_7243.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_095958\_000002412057\_00036\_26643\_7248.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_103826\_000006882057\_00037\_26644\_7307.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_104916\_000002472057\_00037\_26644\_7351.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_113623\_000004892057\_00037\_26644\_7361.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_121832\_000005312057\_00038\_26645\_7387.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_125354\_000000782057\_00038\_26645\_7434.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_125806\_000001992057\_00038\_26645\_7436.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_130136\_000001082057\_00038\_26645\_7438.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_130913\_000001632057\_00038\_26645\_7443.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_131838\_000003922057\_00038\_26645\_7448.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_133106\_000004532057\_00038\_26645\_7450.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK  
ASA\_GM1\_1PNPDK20070405\_135247\_000008942057\_00039\_26646\_7463.N1 ASA\_CON -> OKASA\_INS -> OKASA\_XCH -> OKASA\_XCA -> OK

ASA_GM1_1PNPDK20070405_140658_000003082057_00039_26646_7573.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_141433_000001872057_00039_26646_7575.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_142935_000004592057_00039_26646_7580.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_154429_000001932057_00040_26647_7715.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_155219_000004162057_00040_26647_7717.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_160202_000001932057_00040_26647_7719.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_163025_000004772057_00040_26647_7721.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_164028_000003562057_00040_26647_7733.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_170851_000001262057_00041_26648_7731.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_171544_000004162057_00041_26648_7738.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_172135_000003982057_00041_26648_7828.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_173108_000000722057_00041_26648_7830.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_173839_000002472057_00041_26648_7832.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_181101_000005312057_00041_26648_7837.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_182530_000000902057_00041_26648_7835.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_184804_000003622057_00042_26649_7842.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_185712_000002772057_00042_26649_7847.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_190047_000003862057_00042_26649_7940.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_190958_000004712057_00042_26649_7947.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_195137_000002172057_00042_26649_7949.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_200626_000000662057_00042_26649_7951.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20070405_202047_000007732057_00042_26649_7970.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

\*\*\*\*\*

Analysing APM products...

Writing file ./RESULTS/DAILY/070405/AUXILIARY/Check\_ADFs\_APM.xls...

Writing file ./RESULTS/DAILY/070405/AUXILIARY/Check\_ADFs\_APM.txt...

ASA_APM_1PNPDE20070405_021054_000000402057_00032_26639_9434.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20070405_053251_000000422057_00034_26641_9744.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20070405_061318_000000732057_00034_26641_9956.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20070405_061607_000000602057_00034_26641_9948.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20070405_074544_000001992057_00035_26642_9928.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20070405_091846_000000422057_00036_26643_9935.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20070405_115821_000001002057_00037_26644_0037.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20070405_201805_000001342057_00042_26649_0225.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20070405_220747_000000422057_00044_26651_0456.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDK20070405_091157_000000722057_00036_26643_7230.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDK20070405_134851_000000562057_00039_26646_7533.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

\*\*\*\*\*

Analysing IMM products...

Writing file ./RESULTS/DAILY/070405/AUXILIARY/Check\_ADFs\_IMM.xls...

Writing file ./RESULTS/DAILY/070405/AUXILIARY/Check\_ADFs\_IMM.txt...

ASA_IMM_1PNPDE20070405_003838_000000902057_00031_26638_9360.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070405_011540_000000352057_00031_26638_9301.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070405_074211_000001882057_00035_26642_9916.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070405_074943_000002972057_00035_26642_9930.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070405_075748_000000342057_00035_26642_9898.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070405_153216_000000662057_00040_26647_0098.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20070405_171057_000002692057_00041_26648_0128.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20070405_105430_000001612057_00037_26644_7332.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20070405_122817_000000362057_00038_26645_7356.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20070405_123011_000002182057_00038_26645_7417.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20070405_135039_000000362057_00039_26646_7531.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20070405_135140_000000502057_00039_26646_7535.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20070405_190714_000000362057_00042_26649_7854.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20070405_203635_000001282057_00043_26650_8014.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20070405_222252_000000562057_00044_26651_8048.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK





\*\*\*\*\*

Analysing WSM products...

Writing file ./RESULTS/DAILY/070405/AUXILIARY/Check\_ADFs\_WSM.xls...

Writing file ./RESULTS/DAILY/070405/AUXILIARY/Check\_ADFs\_WSM.txt...

ASA_WSM_1PNPDE20070405_003333_000002912057_00031_26638_9370.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_005052_000000912057_00031_26638_9430.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_012605_000002752057_00031_26638_9353.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_013549_000000862057_00031_26638_9342.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_015352_000000922057_00031_26638_9428.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_015752_000003292057_00031_26638_9551.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_022718_000002672057_00032_26639_9481.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_024214_000001412057_00032_26639_9477.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_035118_000000862057_00033_26640_9601.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_040629_000004292057_00033_26640_9750.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_040629_000005452057_00033_26640_9873.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_041433_000000612057_00033_26640_9721.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_042353_000000862057_00033_26640_9688.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_045357_000003612057_00033_26640_9885.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_053122_000000862057_00034_26641_9865.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_053422_000002022057_00034_26641_9875.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_091731_000000672057_00036_26643_9932.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_092523_000000672057_00036_26643_9938.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_092523_000002982057_00036_26643_9958.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_092731_000001702057_00036_26643_9954.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_095849_000000612057_00036_26643_9960.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_103517_000001712057_00037_26644_9985.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_110357_000002322057_00037_26644_0008.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_112949_000003852057_00037_26644_0006.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_121515_000001772057_00038_26645_0055.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_125522_000001532057_00038_26645_0039.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_152347_000002442057_00040_26647_0130.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_152852_000000182057_00040_26647_0122.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_152954_000000862057_00040_26647_0126.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_153638_000002612057_00040_26647_0068.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_163832_000001032057_00040_26647_0110.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_182000_000003062057_00041_26648_0179.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_191759_000001282057_00042_26649_0215.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_195526_000001462057_00042_26649_0219.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_195854_000004282057_00042_26649_0221.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_201638_000000852057_00042_26649_0217.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_205447_000003042057_00043_26650_0351.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_213441_000000852057_00043_26650_0349.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_223402_000003662057_00044_26651_0598.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_231412_000001292057_00044_26651_0495.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20070405_231953_000003672057_00044_26651_0592.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070405_054629_000003532057_00034_26641_7009.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070405_063218_000004282057_00034_26641_7088.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070405_071608_000001412057_00035_26642_7083.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070405_081010_000001412057_00035_26642_7226.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070405_090952_000000852057_00036_26643_7228.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070405_131204_000003852057_00038_26645_7565.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070405_141216_000001162057_00039_26646_7563.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070405_154033_000002262057_00040_26647_7697.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070405_154750_000002442057_00040_26647_7707.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070405_154857_000001762057_00040_26647_7699.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070405_172821_000001582057_00041_26648_7817.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070405_190816_000000912057_00042_26649_7926.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070405_203924_000002442057_00043_26650_8046.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070405_204648_000001702057_00043_26650_8044.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20070405_222437_000002932057_00044_26651_8060.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

AUXILIARY FILES ANALYSIS completed

#####

MODULE STEPPING ANALYSIS

#####  
Analysis will be performed from 2007-04-05 00:00:00 to 2007-04-05 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/070405/MODULE\_STEPPING

Creating directory ./RESULTS/DAILY/070405/MODULE\_STEPPING...  
Creating directory ./RESULTS/DAILY/070405/MODULE\_STEPPING/FIRST\_REFERENCE...  
Creating directory ./RESULTS/DAILY/070405/MODULE\_STEPPING/SECOND\_REFERENCE...  
Creating directory ./RESULTS/DAILY/070405/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE...  
Deleting old files...

\*\*\*\*\*  
\*\*\*\*\*  
Creating images comparing with second reference...

Exporting results to the directory ../../RESULTS/DAILY/070405/MODULE\_STEPPING/SECOND\_REFERENCE...

Polarization: H  
Reference product: ASA\_MS\_\_0PNPDK20050922\_062651\_000000152041\_00034\_18625\_0041.N1  
Test product: ASA\_MS\_\_0PNPDK20070405\_062641\_000000162057\_00034\_26641\_0258.N1  
H  
H  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/SECOND\_REFERENCE/TGH\_20070405\_062641-20050922\_062651.png  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/SECOND\_REFERENCE/TPH\_20070405\_062641-20050922\_062651.png  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/SECOND\_REFERENCE/RGH\_20070405\_062641-20050922\_062651.png  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/SECOND\_REFERENCE/RPH\_20070405\_062641-20050922\_062651.png

Polarization: V  
Reference product: ASA\_MS\_\_0PNPDK20050923\_055514\_000000152041\_00048\_18639\_0042.N1  
Test product: ASA\_MS\_\_0PNPDK20070404\_170154\_000000162057\_00026\_26633\_0257.N1  
V  
V  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/SECOND\_REFERENCE/TGV\_20070404\_170154-20050923\_055514.png  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/SECOND\_REFERENCE/TPV\_20070404\_170154-20050923\_055514.png  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/SECOND\_REFERENCE/RGV\_20070404\_170154-20050923\_055514.png  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/SECOND\_REFERENCE/RPV\_20070404\_170154-20050923\_055514.png

\*\*\*\*\*  
\*\*\*\*\*  
Creating images comparing with previous product reference...

Exporting results to the directory ../../RESULTS/DAILY/070405/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE...

Polarization: H  
Reference product: ASA\_MS\_\_0PNPDK20070403\_173331\_000000162057\_00012\_26619\_0256.N1  
Test product: ASA\_MS\_\_0PNPDK20070405\_062641\_000000162057\_00034\_26641\_0258.N1  
H  
H  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TGH\_20070405\_062641-20070403\_173331.png  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TPH\_20070405\_062641-20070403\_173331.png  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RGH\_20070405\_062641-20070403\_173331.png  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RPH\_20070405\_062641-20070403\_173331.png

Polarization: V  
Reference product: ASA\_MS\_\_0PNPDK20070402\_180508\_000000162056\_00499\_26605\_0255.N1  
Test product: ASA\_MS\_\_0PNPDK20070404\_170154\_000000162057\_00026\_26633\_0257.N1  
V  
V  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TGV\_20070404\_170154-20070402\_180508.png  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TPV\_20070404\_170154-20070402\_180508.png  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RGV\_20070404\_170154-20070402\_180508.png  
../../RESULTS/DAILY/070405/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RPV\_20070404\_170154-20070402\_180508.png

MODULE\_STEPPING ANALYSIS completed  
#####



CALIBRATION PULSES ANALYSIS

#####

Creating directory ./RESULTS/DAILY/070405/CALIBRATION\_PULSES...

\*\*\*\*\*  
\*\*\*\*\*

ALL ROWS Analysis will be performed from 2007-04-05 00:00:00 to 2007-04-05 23:59:59

Analysing products WVS IS2 V/V

Writing image ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Calibration\_pulses\_all\_rows\_WVS\_IS2\_VV.png...

Analysing products GM1 SS3 H/H

Writing image ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Calibration\_pulses\_all\_rows\_GM1\_SS3\_HH.png...

\*\*\*\*\*  
\*\*\*\*\*

TEMPORAL EVOLUTION Analysis will be performed from 2007-04-05 00:00:00 to 2007-04-05 23:59:59

Analysing products WVS IS2 V/V

Getting calibration pulses data for WVS IS2 V/V from 2007-04-05 00:00:00 to 2007-04-05 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/070405/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2007-04-05\_1.dat...

Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_1.png...

Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2007-04-05 00:00:00 to 2007-04-05 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/070405/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2007-04-05\_2.dat...

Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_2.png...

Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2007-04-05 00:00:00 to 2007-04-05 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/070405/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2007-04-05\_3.dat...

Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_3.png...

Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2007-04-05 00:00:00 to 2007-04-05 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/070405/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2007-04-05\_4.dat...

Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_4.png...

Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_4.png...

Analysing products GM1 SS3 H/H

Getting calibration pulses data for GM1 SS3 H/H from 2007-04-05 00:00:00 to 2007-04-05 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/070405/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2007-04-05\_1.dat...

Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_1.png...

Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_1.png...

Getting calibration pulses data for GM1 SS3 H/H from 2007-04-05 00:00:00 to 2007-04-05 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/070405/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2007-04-05\_2.dat...

Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_2.png...

Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2007-04-05 00:00:00 to 2007-04-05 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/070405/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2007-04-05\_3.dat...

Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_3.png...

Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2007-04-05 00:00:00 to 2007-04-05 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/070405/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2007-04-05\_4.dat...  
Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_4.png...  
Writing ../../RESULTS/DAILY/070405//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_4.png...

CALIBRATION PULSES ANALYSIS completed

#####

DOPPLER ANALYSIS

#####

Creating directory ./RESULTS/DAILY/070405/DOPPLER...

\*\*\*\*\*  
\*\*\*\*\*

DOPPLER ANX Analysis will be performed from 2007-04-05 00:00:00 to 2007-04-05 23:59:59

Analysing products WVS IS2 V/V

Getting doppler data for WVS IS2 V/V from 2007-04-05 00:00:00 to 2007-04-05 23:59:59...

Writing file ./RESULTS/DAILY/070405/DOPPLER/Doppler\_data\_WVS\_IS2\_VV\_2007-04-05.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/070405/DOPPLER/DOPPLER\_ANX\_WVS\_IS2\_VV.png...

Analysing products GM1 SS1 H/H

Getting doppler data for GM1 SS1 H/H from 2007-04-05 00:00:00 to 2007-04-05 23:59:59...

Writing file ./RESULTS/DAILY/070405/DOPPLER/Doppler\_data\_GM1\_SS1\_HH\_2007-04-05.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/070405/DOPPLER/DOPPLER\_ANX\_GM1\_SS1\_HH.png...

\*\*\*\*\*  
\*\*\*\*\*

DOPPLER JUMPS Analysis will be performed on WSM products from 2007-04-05 00:00:00 to 2007-04-05 23:59:59

Analysing by default products WSM

Getting doppler jumps data for WSM from 2007-04-05 00:00:00 to 2007-04-05 23:59:59...

Writing file ./RESULTS/DAILY/070405/DOPPLER/Doppler\_Jumps\_data\_WSM\_2007-04-05.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/070405/DOPPLER/DOPPLER\_JUMPS\_ANX\_WSM.png...

Writing file ../../RESULTS/DAILY/070405/DOPPLER/DOPPLER\_JUMPS\_Date\_WSM.png...

\*\*\*\*\*  
\*\*\*\*\*

DOPPLER MAP Analysis will be performed from 2007-04-05 00:00:00 to 2007-04-05 23:59:59

Analysing products WVS IS2 V/V

Loading predicted doppler values....

Phase: descending

Found data...

Computing mean error doppler estimated-predicted...

Mean error = -14.569352 Hz

Writing file ../../RESULTS/DAILY/070405//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_WVS\_IS2\_VV\_desc.jpg...

Writing file ../../RESULTS/DAILY/070405//DOPPLER/DOPPLER\_Absolute\_WVS\_IS2\_VV\_desc.jpg...

\*\*\*\*\*

Loading predicted doppler values....

Phase: ascending

Found data...

Computing mean error doppler estimated-predicted...

Mean error = -17.230557 Hz

Writing file ../../RESULTS/DAILY/070405//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_WVS\_IS2\_VV\_asc.jpg...

Writing file ../../RESULTS/DAILY/070405//DOPPLER/DOPPLER\_Absolute\_WVS\_IS2\_VV\_asc.jpg...



\*\*\*\*\*

Analysing products GM1 SS1 H/H  
Loading predicted doppler values....  
Phase: descending  
Found data...  
Computing mean error doppler estimated-predicted...  
Mean error = -11.053199 Hz  
Writing file ../../RESULTS/DAILY/070405//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_GM1\_SS1\_HH\_desc.jpg...  
Writing file ../../RESULTS/DAILY/070405//DOPPLER/DOPPLER\_Absolute\_GM1\_SS1\_HH\_desc.jpg...

\*\*\*\*\*

Loading predicted doppler values....  
Phase: ascending  
Found data...  
Computing mean error doppler estimated-predicted...  
Mean error = -18.743626 Hz  
Writing file ../../RESULTS/DAILY/070405//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_GM1\_SS1\_HH\_asc.jpg...  
Writing file ../../RESULTS/DAILY/070405//DOPPLER/DOPPLER\_Absolute\_GM1\_SS1\_HH\_asc.jpg...

\*\*\*\*\*

DOPPLER ANALYSIS completed  
#####

CHIRP ANALYSIS  
#####  
Creating directory ./RESULTS/DAILY/070405/CHIRP...

\*\*\*\*\*  
\*\*\*\*\*  
CHIRP Analysis will be performed from 2007-04-05 00:00:00 to 2007-04-05 23:59:59

Analysing products WSM SS1 H/H  
\*\*\*\*\*  
Getting ScaleFactor data for WSM SS1 H/H from 2007-04-05 00:00:00 to 2007-04-05 23:59:59...  
Writing file ./RESULTS/DAILY/070405/CHIRP/ScaleFactor\_data\_WSM\_SS1\_HH\_2007-04-05.dat...  
Running IDL program...  
Writing file ../../RESULTS/DAILY/070405/CHIRP/ScaleFactor\_ANX\_WSM\_SS1\_HH.png...  
Writing file ../../RESULTS/DAILY/070405/CHIRP/ScaleFactor\_DATE\_WSM\_SS1\_HH.png...

CHIRP ANALYSIS completed  
#####

RAW DATA ANALYSIS  
#####  
Analysis will be performed from 2007-04-05 00:00:00 to 2007-04-05 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/070405/RAW\_DATA  
  
Creating directory ./RESULTS/DAILY/070405/RAW\_DATA...

\*\*\*\*\*  
Getting raw data for WVS from 2007-04-05 00:00:00 to 2007-04-05 23:59:59...  
Writing file ./RESULTS/DAILY/070405/RAW\_DATA/Raw\_data\_WVS\_2007-04-05.dat...  
Running IDL program to create graphs...  
  
Creating image ../../RESULTS/DAILY/070405/RAW\_DATA/Raw\_data\_WVS\_input\_mean.png...  
Creating image ../../RESULTS/DAILY/070405/RAW\_DATA/Raw\_data\_WVS\_input\_stdev.png...

Creating image ../../RESULTS/DAILY/070405/RAW\_DATA/Raw\_data\_WVS\_gain\_imbalance.png...

\*\*\*\*\*  
Getting raw data for WSM from 2007-04-05 00:00:00 to 2007-04-05 23:59:59...

Writing file ./RESULTS/DAILY/070405/RAW\_DATA/Raw\_data\_WSM\_2007-04-05.dat...  
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/070405/RAW\_DATA/Raw\_data\_WSM\_input\_mean.png...  
Creating image ../../RESULTS/DAILY/070405/RAW\_DATA/Raw\_data\_WSM\_input\_stdev.png...  
Creating image ../../RESULTS/DAILY/070405/RAW\_DATA/Raw\_data\_WSM\_gain\_imbalance.png...

RAW DATA ANALYSIS completed  
#####

TELEMETRY ANALYSIS  
#####  
Analysis will be performed from 2007-04-05 00:00:00 to 2007-04-05 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/070405/TELEMETRY

Creating directory ./RESULTS/DAILY/070405/TELEMETRY...

Looking for gaps and missing lines in WVS products...  
\*\*\*\*\*

Checking 28 products from PDE...  
Checking 24 products from PDK...

Looking for gaps and missing lines in GM1 products...  
\*\*\*\*\*

Checking 35 products from PDE...  
Checking 44 products from PDK...  
Found product...ASA\_GM1\_1PNPDK20070405\_081244\_000006342057\_00035\_26642\_7111.N1 / 0 gaps / 13 missing lines  
Found product...ASA\_GM1\_1PNPDK20070405\_181101\_000005312057\_00041\_26648\_7837.N1 / 0 gaps / 30 missing lines  
Found product...ASA\_GM1\_1PNPDK20070405\_195137\_000002172057\_00042\_26649\_7949.N1 / 0 gaps / 12 missing lines

Looking for gaps and missing lines in APM products...  
\*\*\*\*\*

Checking 9 products from PDE...  
Checking 2 products from PDK...

Looking for gaps and missing lines in IMM products...  
\*\*\*\*\*

Checking 7 products from PDE...  
Checking 8 products from PDK...

Looking for gaps and missing lines in WSM products...  
\*\*\*\*\*

Checking 41 products from PDE...  
Found product...ASA\_WSM\_1PNPDE20070405\_091731\_00000672057\_00036\_26643\_9932.N1 / 0 gaps / 1 missing lines  
Checking 15 products from PDK...

Creating graph of missing lines and gaps...  
\*\*\*\*\*  
Creating image: ./RESULTS/DAILY/070405/TELEMETRY/TELEMETRY\_Missing\_lines.png...  
Creating image: ./RESULTS/DAILY/070405/TELEMETRY/TELEMETRY\_Gaps.png...

TELEMETRY ANALYSIS completed  
#####

BROWSE PRODUCTS ANALYSIS  
#####  
Analysis will be performed on 2007-04-05



\*\*\*\*\*

Scanning directory /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP...  
Results will be exported to the directory: /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/JPG/20070405/

Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_004026\_000006102057\_00031\_26638\_9191.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_005307\_000001022057\_00031\_26638\_9196.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_011153\_000002232057\_00031\_26638\_9198.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_011632\_000000902057\_00031\_26638\_9203.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_013052\_000002892057\_00031\_26638\_9208.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_013727\_000002112057\_00031\_26638\_9210.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_014933\_000002232057\_00031\_26638\_9348.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_021202\_000009002057\_00032\_26639\_9350.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_023208\_000004532057\_00032\_26639\_9359.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_024047\_000000782057\_00032\_26639\_9373.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_030537\_000009242057\_00032\_26639\_9507.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_032431\_000003382057\_00032\_26639\_9502.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_033417\_000002652057\_00032\_26639\_9500.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_034121\_000000962057\_00033\_26640\_9514.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_034657\_000002532057\_00033\_26640\_9509.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_035252\_000008092057\_00033\_26640\_9528.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_041551\_000004712057\_00033\_26640\_9533.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_042527\_000000662057\_00033\_26640\_9544.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_045131\_000001382057\_00033\_26640\_9740.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_050005\_000001262057\_00033\_26640\_9753.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_052633\_000002772057\_00034\_26641\_9763.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_053756\_000005012057\_00034\_26641\_9761.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_055234\_000007372057\_00034\_26641\_9785.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_204400\_000001572057\_00043\_26650\_0224.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_204946\_000002892057\_00043\_26650\_0232.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_213213\_000001382057\_00043\_26650\_0228.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_213619\_000001382057\_00043\_26650\_0230.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_214604\_000001262057\_00043\_26650\_0234.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_220854\_000003742057\_00044\_26651\_0363.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_222941\_000002472057\_00044\_26651\_0365.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_230352\_000001202057\_00044\_26651\_0367.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_231249\_000000722057\_00044\_26651\_0372.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_231645\_000001752057\_00044\_26651\_0374.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDE20070405\_232623\_000001442057\_00044\_26651\_0387.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_062805\_000002412057\_00034\_26641\_7015.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_063937\_000001872057\_00034\_26641\_7020.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_071842\_000005862057\_00035\_26642\_7034.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_072747\_000005862057\_00035\_26642\_7096.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_075457\_000001692057\_00035\_26642\_7098.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_075841\_000001322057\_00035\_26642\_7100.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_080725\_000001572057\_00035\_26642\_7102.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_081244\_000006342057\_00035\_26642\_7112.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_085835\_000006642057\_00036\_26643\_7179.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_094801\_000002832057\_00036\_26643\_7244.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_095958\_000002412057\_00036\_26643\_7249.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_103826\_000006882057\_00037\_26644\_7308.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_104916\_000002472057\_00037\_26644\_7352.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_113623\_000004892057\_00037\_26644\_7362.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_121832\_000005312057\_00038\_26645\_7388.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_125354\_000000782057\_00038\_26645\_7435.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_125806\_000001992057\_00038\_26645\_7437.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_130136\_000001082057\_00038\_26645\_7439.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_130913\_000001632057\_00038\_26645\_7444.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_131838\_000003922057\_00038\_26645\_7449.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_133106\_000004532057\_00038\_26645\_7451.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_135247\_000008942057\_00039\_26646\_7464.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_140658\_000003082057\_00039\_26646\_7574.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_141433\_000001872057\_00039\_26646\_7576.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_142935\_000004592057\_00039\_26646\_7581.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_144948\_000009242057\_00039\_26646\_7586.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_153339\_000001692057\_00040\_26647\_7588.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_154429\_000001932057\_00040\_26647\_7716.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_GM\_BP/ASA\_GM\_BPZPDK20070405\_155219\_000004162057\_00040\_26647\_7718.N1 ...

```
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_160202_000001932057_00040_26647_7720.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_163025_000004772057_00040_26647_7722.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_164028_000003562057_00040_26647_7734.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_170851_000001262057_00041_26648_7732.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_171544_000004162057_00041_26648_7739.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_172135_000003982057_00041_26648_7829.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_173108_000000722057_00041_26648_7831.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_173839_000002472057_00041_26648_7833.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_181101_000005312057_00041_26648_7838.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_182530_000000902057_00041_26648_7836.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_184804_000003622057_00042_26649_7843.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_185712_000002772057_00042_26649_7848.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_190047_000003862057_00042_26649_7941.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_190958_000004712057_00042_26649_7948.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_195137_000002172057_00042_26649_7950.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_200626_000000662057_00042_26649_7952.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_GM_BP/ASA_GM_BPZPDK20070405_202047_000007732057_00042_26649_7971.N1 ...
```

ANALYSIS COMPLETED: 80 GM browse products to see...

\*\*\*\*\*

\*\*\*\*\*

Scanning directory /usr/home/ASAR/ASAR\_Data/ASA\_AP\_BP...

Results will be exported to the directory: /usr/home/ASAR/ASAR\_Data/ASA\_AP\_BP/JPG/20070405/

```
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_AP_BP/ASA_AP_BPZPDE20070405_021054_000000402057_00032_26639_9435.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_AP_BP/ASA_AP_BPZPDE20070405_053251_000000422057_00034_26641_9745.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_AP_BP/ASA_AP_BPZPDE20070405_061318_000000732057_00034_26641_9957.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_AP_BP/ASA_AP_BPZPDE20070405_061607_000000602057_00034_26641_9949.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_AP_BP/ASA_AP_BPZPDE20070405_074544_000001992057_00035_26642_9929.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_AP_BP/ASA_AP_BPZPDE20070405_091846_000000422057_00036_26643_9936.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_AP_BP/ASA_AP_BPZPDE20070405_115821_000001002057_00037_26644_0038.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_AP_BP/ASA_AP_BPZPDE20070405_201805_000001342057_00042_26649_0226.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_AP_BP/ASA_AP_BPZPDE20070405_220747_000000422057_00044_26651_0457.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_AP_BP/ASA_AP_BPZPDK20070405_091157_000000722057_00036_26643_7231.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_AP_BP/ASA_AP_BPZPDK20070405_134851_000000562057_00039_26646_7534.N1 ...
```

ANALYSIS COMPLETED: 11 AP browse products to see...

\*\*\*\*\*

\*\*\*\*\*

Scanning directory /usr/home/ASAR/ASAR\_Data/ASA\_IM\_BP...

Results will be exported to the directory: /usr/home/ASAR/ASAR\_Data/ASA\_IM\_BP/JPG/20070405/

```
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDE20070405_003838_000000902057_00031_26638_9361.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDE20070405_011540_000000352057_00031_26638_9302.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDE20070405_023940_000000512057_00032_26639_9352.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDE20070405_073734_000000362057_00035_26642_9888.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDE20070405_074211_000001882057_00035_26642_9917.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDE20070405_074943_000002972057_00035_26642_9931.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDE20070405_075748_000000342057_00035_26642_9899.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDE20070405_153216_000000662057_00040_26647_0099.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDE20070405_171057_000002692057_00041_26648_0129.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDE20070405_173223_000000362057_00041_26648_0133.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDE20070405_173716_000000642057_00041_26648_0169.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDE20070405_174247_000000652057_00041_26648_0159.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDK20070405_105430_000001612057_00037_26644_7333.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDK20070405_122817_000000362057_00038_26645_7357.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDK20070405_123011_000002182057_00038_26645_7418.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDK20070405_135039_000000362057_00039_26646_7532.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDK20070405_135140_000000502057_00039_26646_7536.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDK20070405_190714_000000362057_00042_26649_7855.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDK20070405_203635_000001282057_00043_26650_8015.N1 ...
Stripping browse product /usr/home/ASAR/ASAR_Data/ASA_IM_BP/ASA_IM_BPZPDK20070405_222252_000000562057_00044_26651_8049.N1 ...
```

ANALYSIS COMPLETED: 20 IM browse products to see...

\*\*\*\*\*



\*\*\*\*\*

Scanning directory /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP...

Results will be exported to the directory: /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/JPG/20070405/

Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_003333\_000002912057\_00031\_26638\_9371.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_005052\_000000912057\_00031\_26638\_9431.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_012605\_000002752057\_00031\_26638\_9354.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_013549\_000000862057\_00031\_26638\_9343.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_015352\_000000922057\_00031\_26638\_9429.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_015752\_000003292057\_00031\_26638\_9552.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_022718\_000002672057\_00032\_26639\_9482.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_024214\_000001412057\_00032\_26639\_9478.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_024514\_000000862057\_00032\_26639\_9476.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_035118\_000000862057\_00033\_26640\_9602.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_040629\_000004292057\_00033\_26640\_9751.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_040629\_000005452057\_00033\_26640\_9874.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_041433\_000000612057\_00033\_26640\_9722.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_042353\_000000862057\_00033\_26640\_9689.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_044719\_000002392057\_00033\_26640\_9724.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_045357\_000003612057\_00033\_26640\_9886.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_053122\_000000862057\_00034\_26641\_9866.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_053422\_000002022057\_00034\_26641\_9876.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_091731\_000000672057\_00036\_26643\_9933.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_092523\_000000672057\_00036\_26643\_9939.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_092523\_000002982057\_00036\_26643\_9959.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_092731\_000001702057\_00036\_26643\_9955.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_095849\_000000612057\_00036\_26643\_9961.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_103517\_000001712057\_00037\_26644\_9986.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_110357\_000002322057\_00037\_26644\_0009.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_112949\_000003852057\_00037\_26644\_0007.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_121515\_000001772057\_00038\_26645\_0056.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_125136\_000001282057\_00038\_26645\_0046.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_125522\_000001532057\_00038\_26645\_0040.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_141751\_000000862057\_00039\_26646\_0125.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_152347\_000002442057\_00040\_26647\_0131.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_152347\_000003232057\_00040\_26647\_0171.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_152852\_000000182057\_00040\_26647\_0123.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_152954\_000000862057\_00040\_26647\_0127.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_153638\_000002612057\_00040\_26647\_0069.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_163832\_000001032057\_00040\_26647\_0111.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_170442\_000002382057\_00041\_26648\_0175.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_173419\_000001462057\_00041\_26648\_0173.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_182000\_000003062057\_00041\_26648\_0180.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_191759\_000001282057\_00042\_26649\_0216.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_195526\_000001462057\_00042\_26649\_0220.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_195854\_000004282057\_00042\_26649\_0222.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_201638\_000000852057\_00042\_26649\_0218.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_205447\_000003042057\_00043\_26650\_0352.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_213441\_000000852057\_00043\_26650\_0350.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_213850\_000004222057\_00043\_26650\_0455.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_223402\_000003662057\_00044\_26651\_0599.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_231412\_000001292057\_00044\_26651\_0496.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDE20070405\_231953\_000003672057\_00044\_26651\_0593.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDK20070405\_054629\_000003532057\_00034\_26641\_7010.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDK20070405\_063218\_000004282057\_00034\_26641\_7089.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDK20070405\_071608\_000001412057\_00035\_26642\_7084.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDK20070405\_081010\_000001412057\_00035\_26642\_7227.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDK20070405\_090952\_000000852057\_00036\_26643\_7229.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDK20070405\_091353\_000002452057\_00036\_26643\_7236.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDK20070405\_131204\_000003852057\_00038\_26645\_7566.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDK20070405\_141216\_000001162057\_00039\_26646\_7564.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDK20070405\_154033\_000002262057\_00040\_26647\_7698.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDK20070405\_154750\_000002442057\_00040\_26647\_7708.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDK20070405\_154857\_000001762057\_00040\_26647\_7700.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDK20070405\_172821\_000001582057\_00041\_26648\_7818.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDK20070405\_190816\_000000912057\_00042\_26649\_7927.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDK20070405\_203924\_000002442057\_00043\_26650\_8047.N1 ...  
Stripping browse product /usr/home/ASAR/ASAR\_Data/ASA\_WS\_BP/ASA\_WS\_BPZPDK20070405\_204648\_000001702057\_00043\_26650\_8045.N1 ...



ANALYSIS COMPLETED: 64 WS browse products to see...  
\*\*\*\*\*

BROWSE PRODUCTS ANALYSIS completed  
#####

HTML REPORT generation  
#####

Building file ./RESULTS/DAILY/070405/asarReport.html...  
Building DATA SUMMARY section...  
Building AUXILIARY FILES ANALYSIS section...  
Building MODULE STEPPING ANALYSIS section...  
Building CALIBRATION PULSES ANALYSIS section...  
Building DOPPLER ANALYSIS section...  
Building CHIRP ANALYSIS section...  
Building RAW DATA ANALYSIS section...  
Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed  
#####

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20070405_021054_000000402057_00032_26639_9434.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20070405_053251_000000422057_00034_26641_9744.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20070405_061318_000000732057_00034_26641_9956.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20070405_061607_000000602057_00034_26641_9948.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20070405_074544_000001992057_00035_26642_9928.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20070405_091846_000000422057_00036_26643_9935.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20070405_115821_000001002057_00037_26644_0037.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20070405_201805_000001342057_00042_26649_0225.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20070405_220747_000000422057_00044_26651_0456.N1	OK	OK	OK	OK
ASA_APM_1PNPDK20070405_091157_000000722057_00036_26643_7230.N1	OK	OK	OK	OK
ASA_APM_1PNPDK20070405_134851_000000562057_00039_26646_7533.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20070405_004026_000006102057_00031_26638_9190.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_005307_000001022057_00031_26638_9195.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_011153_000002232057_00031_26638_9197.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_011632_000000902057_00031_26638_9202.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_013052_000002892057_00031_26638_9207.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_013727_000002112057_00031_26638_9209.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_014933_000002232057_00031_26638_9347.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_021202_000009002057_00032_26639_9349.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_023208_000004532057_00032_26639_9358.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_024047_000000782057_00032_26639_9372.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_030537_000009242057_00032_26639_9506.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_032431_000003382057_00032_26639_9501.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_033417_000002652057_00032_26639_9499.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_034121_000000962057_00033_26640_9513.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_034657_000002532057_00033_26640_9508.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_035252_000008092057_00033_26640_9527.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_041551_000004712057_00033_26640_9532.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_042527_000000662057_00033_26640_9543.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_045131_000001382057_00033_26640_9739.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_050005_000001262057_00033_26640_9752.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_052633_000002772057_00034_26641_9762.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_053756_000005012057_00034_26641_9760.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_055234_000007372057_00034_26641_9784.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_204400_000001572057_00043_26650_0223.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_204946_000002892057_00043_26650_0231.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_213213_000001382057_00043_26650_0227.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_213619_000001382057_00043_26650_0229.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_214604_000001262057_00043_26650_0233.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_220854_000003742057_00044_26651_0362.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_222941_000002472057_00044_26651_0364.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_230352_000001202057_00044_26651_0366.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_231249_000000722057_00044_26651_0371.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_231645_000001752057_00044_26651_0373.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20070405_232623_000001442057_00044_26651_0386.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_062805_000002412057_00034_26641_7014.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_063937_000001872057_00034_26641_7019.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_071842_000005862057_00035_26642_7033.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_072747_000005862057_00035_26642_7095.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_075457_000001692057_00035_26642_7097.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_075841_000001322057_00035_26642_7099.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_080725_000001572057_00035_26642_7101.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_081244_000006342057_00035_26642_7111.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_085835_000006642057_00036_26643_7178.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_094801_000002832057_00036_26643_7243.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_095958_000002412057_00036_26643_7248.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_103826_000006882057_00037_26644_7307.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_104916_000002472057_00037_26644_7351.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_113623_000004892057_00037_26644_7361.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_121832_000005312057_00038_26645_7387.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_125354_000000782057_00038_26645_7434.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_125806_000001992057_00038_26645_7436.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_130136_000001082057_00038_26645_7438.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_130913_000001632057_00038_26645_7443.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_131838_000003922057_00038_26645_7448.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_133106_000004532057_00038_26645_7450.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_135247_000008942057_00039_26646_7463.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_140658_000003082057_00039_26646_7573.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_141433_000001872057_00039_26646_7575.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_142935_000004592057_00039_26646_7580.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_154429_000001932057_00040_26647_7715.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_155219_000004162057_00040_26647_7717.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_160202_000001932057_00040_26647_7719.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_163025_000004772057_00040_26647_7721.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_164028_000003562057_00040_26647_7733.N1					OK	OK	OK	OK



ASA_GM1_1PNPDK20070405_170851_000001262057_00041_26648_7731.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_171544_000004162057_00041_26648_7738.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_172135_000003982057_00041_26648_7828.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_173108_000000722057_00041_26648_7830.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_173839_000002472057_00041_26648_7832.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_181101_000005312057_00041_26648_7837.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_182530_000000902057_00041_26648_7835.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_184804_000003622057_00042_26649_7842.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_185712_000002772057_00042_26649_7847.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_190047_000003862057_00042_26649_7940.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_190958_000004712057_00042_26649_7947.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_195137_000002172057_00042_26649_7949.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_200626_000000662057_00042_26649_7951.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20070405_202047_000007732057_00042_26649_7970.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_IMM_1PNPDE20070405_003838_000000902057_00031_26638_9360.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070405_011540_000000352057_00031_26638_9301.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070405_074211_000001882057_00035_26642_9916.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070405_074943_000002972057_00035_26642_9930.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070405_075748_000000342057_00035_26642_9898.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070405_153216_000000662057_00040_26647_0098.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20070405_171057_000002692057_00041_26648_0128.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20070405_105430_000001612057_00037_26644_7332.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20070405_122817_000000362057_00038_26645_7356.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20070405_123011_000002182057_00038_26645_7417.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20070405_135039_000000362057_00039_26646_7531.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20070405_135140_000000502057_00039_26646_7535.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20070405_190714_000000362057_00042_26649_7854.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20070405_203635_000001282057_00043_26650_8014.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20070405_222252_000000562057_00044_26651_8048.N1					OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.


Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WSM_1PNPDE20070405_003333_000002912057_00031_26638_9370.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_005052_000000912057_00031_26638_9430.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_012605_000002752057_00031_26638_9353.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_013549_000000862057_00031_26638_9342.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_015352_000000922057_00031_26638_9428.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_015752_000003292057_00031_26638_9551.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_022718_000002672057_00032_26639_9481.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_024214_000001412057_00032_26639_9477.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_035118_000000862057_00033_26640_9601.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_040629_000004292057_00033_26640_9750.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_040629_000005452057_00033_26640_9873.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_041433_000000612057_00033_26640_9721.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_042353_000000862057_00033_26640_9688.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_045357_000003612057_00033_26640_9885.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_053122_000000862057_00034_26641_9865.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_053422_000002022057_00034_26641_9875.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_091731_000000672057_00036_26643_9932.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_092523_000000672057_00036_26643_9938.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_092523_000002982057_00036_26643_9958.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_092731_000001702057_00036_26643_9954.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_095849_000000612057_00036_26643_9960.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_103517_000001712057_00037_26644_9985.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_110357_000002322057_00037_26644_0008.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_112949_000003852057_00037_26644_0006.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_121515_000001772057_00038_26645_0055.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_125522_000001532057_00038_26645_0039.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_152347_000002442057_00040_26647_0130.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_152852_000000182057_00040_26647_0122.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_152954_000000862057_00040_26647_0126.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_153638_000002612057_00040_26647_0068.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_163832_000001032057_00040_26647_0110.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_182000_000003062057_00041_26648_0179.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_191759_000001282057_00042_26649_0215.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_195526_000001462057_00042_26649_0219.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_195854_000004282057_00042_26649_0221.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_201638_000000852057_00042_26649_0217.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_205447_000003042057_00043_26650_0351.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_213441_000000852057_00043_26650_0349.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_223402_000003662057_00044_26651_0598.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_231412_000001292057_00044_26651_0495.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20070405_231953_000003672057_00044_26651_0592.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070405_054629_000003532057_00034_26641_7009.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070405_063218_000004282057_00034_26641_7088.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070405_071608_000001412057_00035_26642_7083.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070405_081010_000001412057_00035_26642_7226.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070405_090952_000000852057_00036_26643_7228.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070405_131204_000003852057_00038_26645_7565.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070405_141216_000001162057_00039_26646_7563.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070405_154033_000002262057_00040_26647_7697.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070405_154750_000002442057_00040_26647_7707.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070405_154857_000001762057_00040_26647_7699.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070405_172821_000001582057_00041_26648_7817.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070405_190816_000000912057_00042_26649_7926.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070405_203924_000002442057_00043_26650_8046.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070405_204648_000001702057_00043_26650_8044.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20070405_222437_000002932057_00044_26651_8060.N1					OK	OK	OK	OK




Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20070405_000024_000003292057_00030_26637_9147.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_000509_000016492057_00030_26637_9193.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_005455_000009652057_00031_26638_9200.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_011802_000003752057_00031_26638_9205.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_014100_000002092057_00031_26638_9218.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_014330_000003152057_00031_26638_9345.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_020323_000003742057_00032_26639_9356.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_024639_000007042057_00032_26639_9368.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_025809_000004052057_00032_26639_9504.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_032136_000001202057_00032_26639_9497.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_033010_000001942057_00032_26639_9494.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_033846_000001042057_00033_26640_9511.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_034301_000001792057_00033_26640_9530.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_042637_000008092057_00033_26640_9536.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_043952_000003302057_00033_26640_9742.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_050212_000014092057_00033_26640_9787.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_060451_000004642057_00034_26641_9765.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_061439_000000442057_00034_26641_9758.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_061717_000001952057_00034_26641_9755.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_205958_000018892057_00043_26650_0239.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_214812_000003152057_00043_26650_0236.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_215242_000007942057_00043_26650_0357.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_221745_000000442057_00044_26651_0354.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_222003_000001352057_00044_26651_0360.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_224114_000013042057_00044_26651_0369.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_230556_000003602057_00044_26651_0376.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_232847_000003152057_00044_26651_0379.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20070405_233318_000017242057_00044_26651_0498.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_062017_000003452057_00034_26641_7017.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_064247_000019492057_00034_26641_7041.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_080055_000003452057_00035_26642_7109.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_082323_000020542057_00035_26642_7193.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_093024_000010042057_00036_26643_7246.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_100359_000018292057_00036_26643_7305.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_105717_000003442057_00037_26644_7346.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_110748_000005542057_00037_26644_7349.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_111718_000006302057_00037_26644_7354.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_114435_000007802057_00037_26644_7359.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_120008_000008542057_00037_26644_7390.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_123355_000010042057_00038_26645_7441.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_130324_000002992057_00038_26645_7446.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_132511_000003002057_00038_26645_7453.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_133842_000005242057_00038_26645_7461.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_142017_000005092057_00039_26646_7578.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_143717_000007052057_00039_26646_7583.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_150547_000010342057_00039_26646_7590.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_160515_000014542057_00040_26647_7724.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_164624_000010492057_00040_26647_7736.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_174507_000014992057_00041_26648_7840.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_183102_000009742057_00041_26648_7845.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_192009_000018442057_00042_26649_7954.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20070405_200736_000004952057_00042_26649_7963.N1					OK	OK	OK	OK

### Calibration pulses for GM1 SS3 H/H

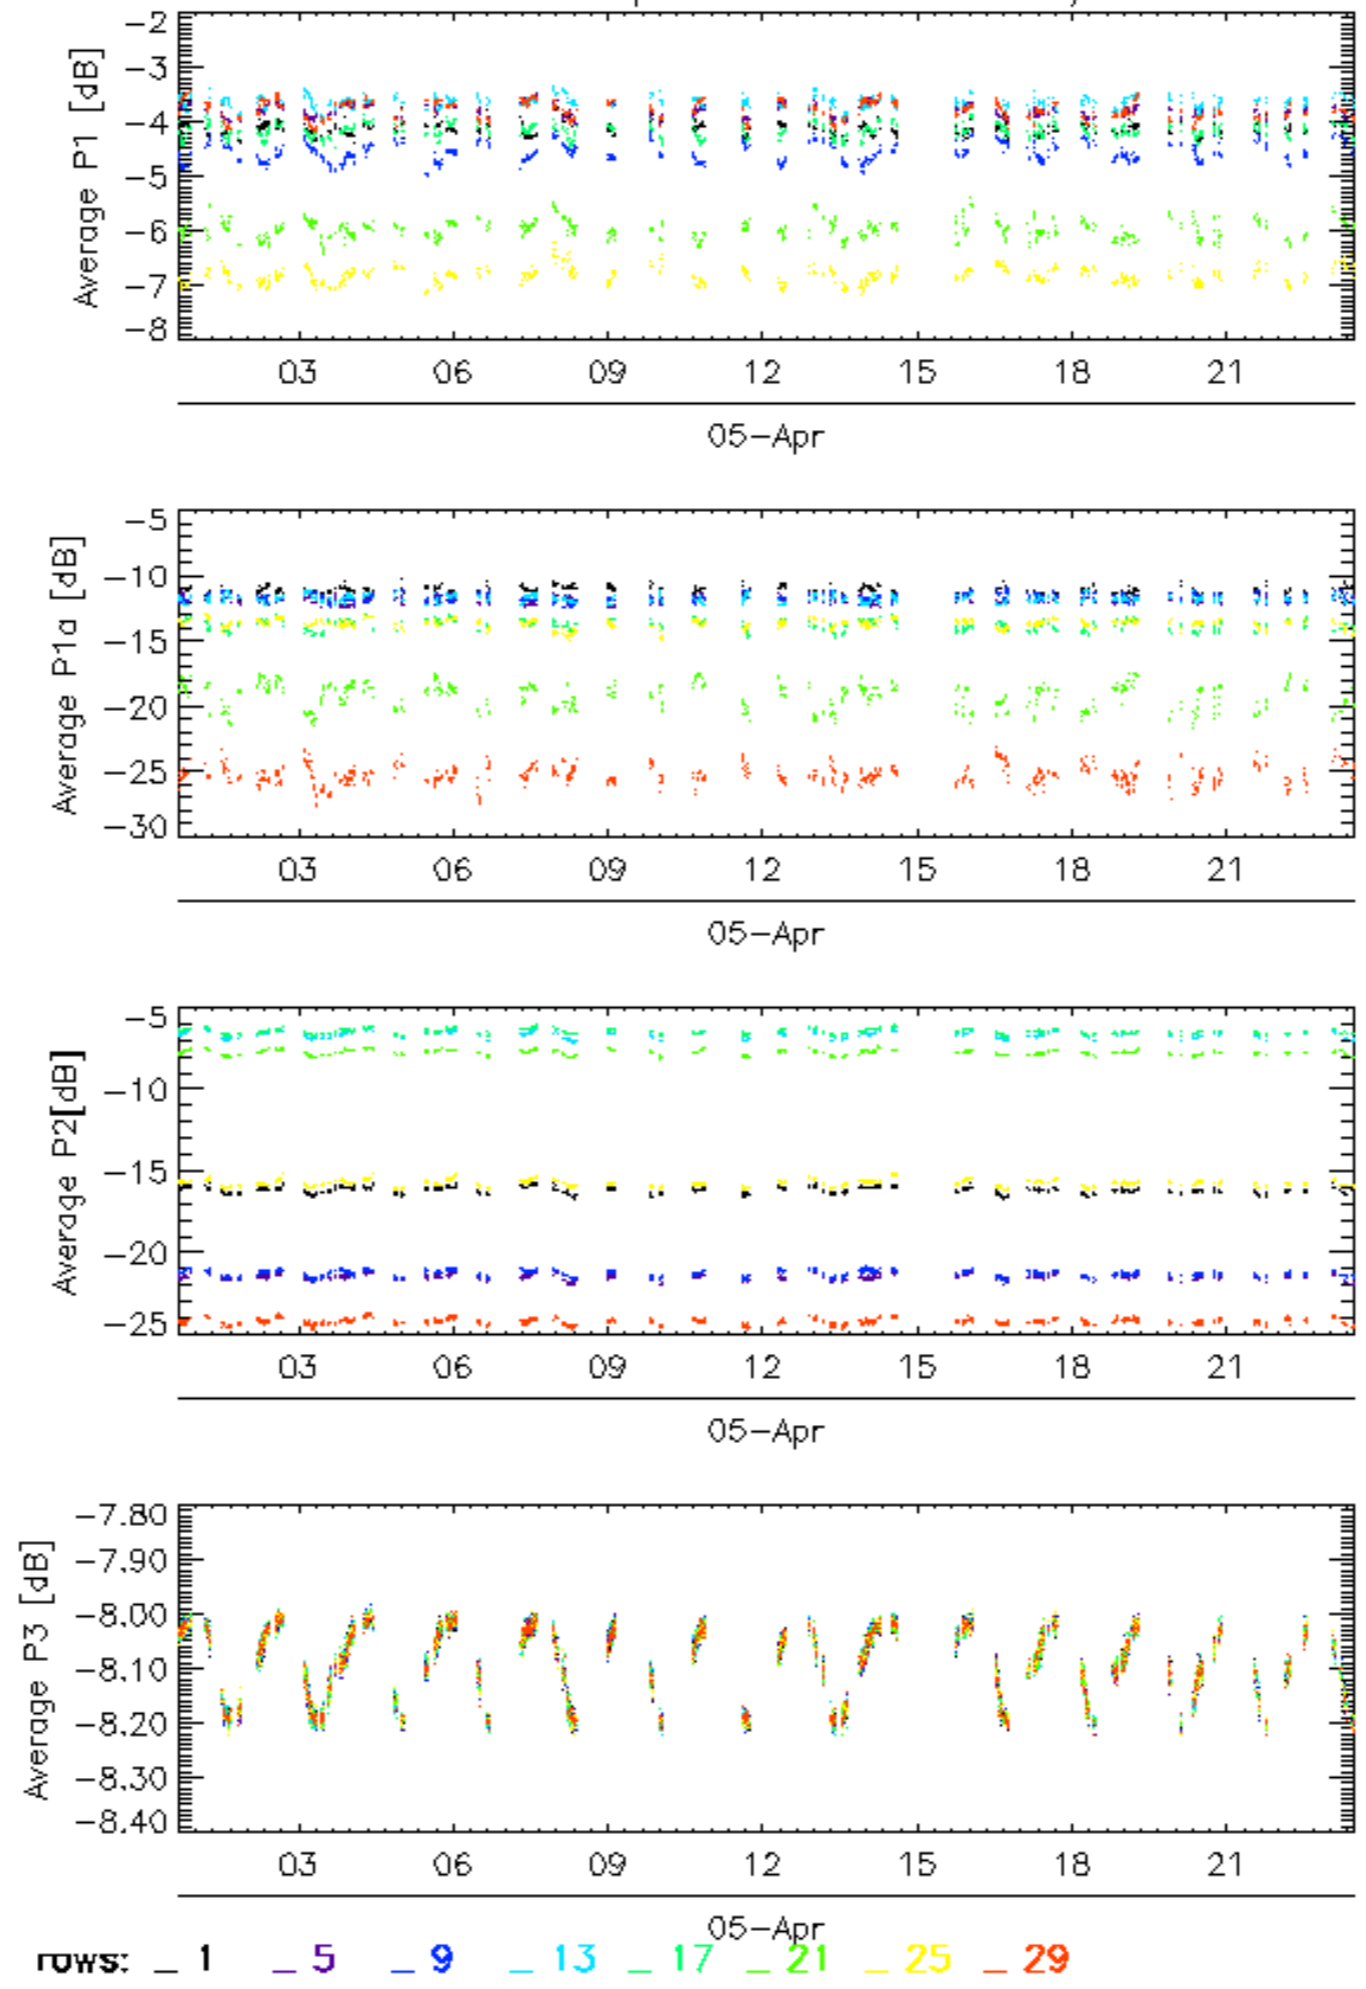


Calibration pulses for GM1 SS3 H/H

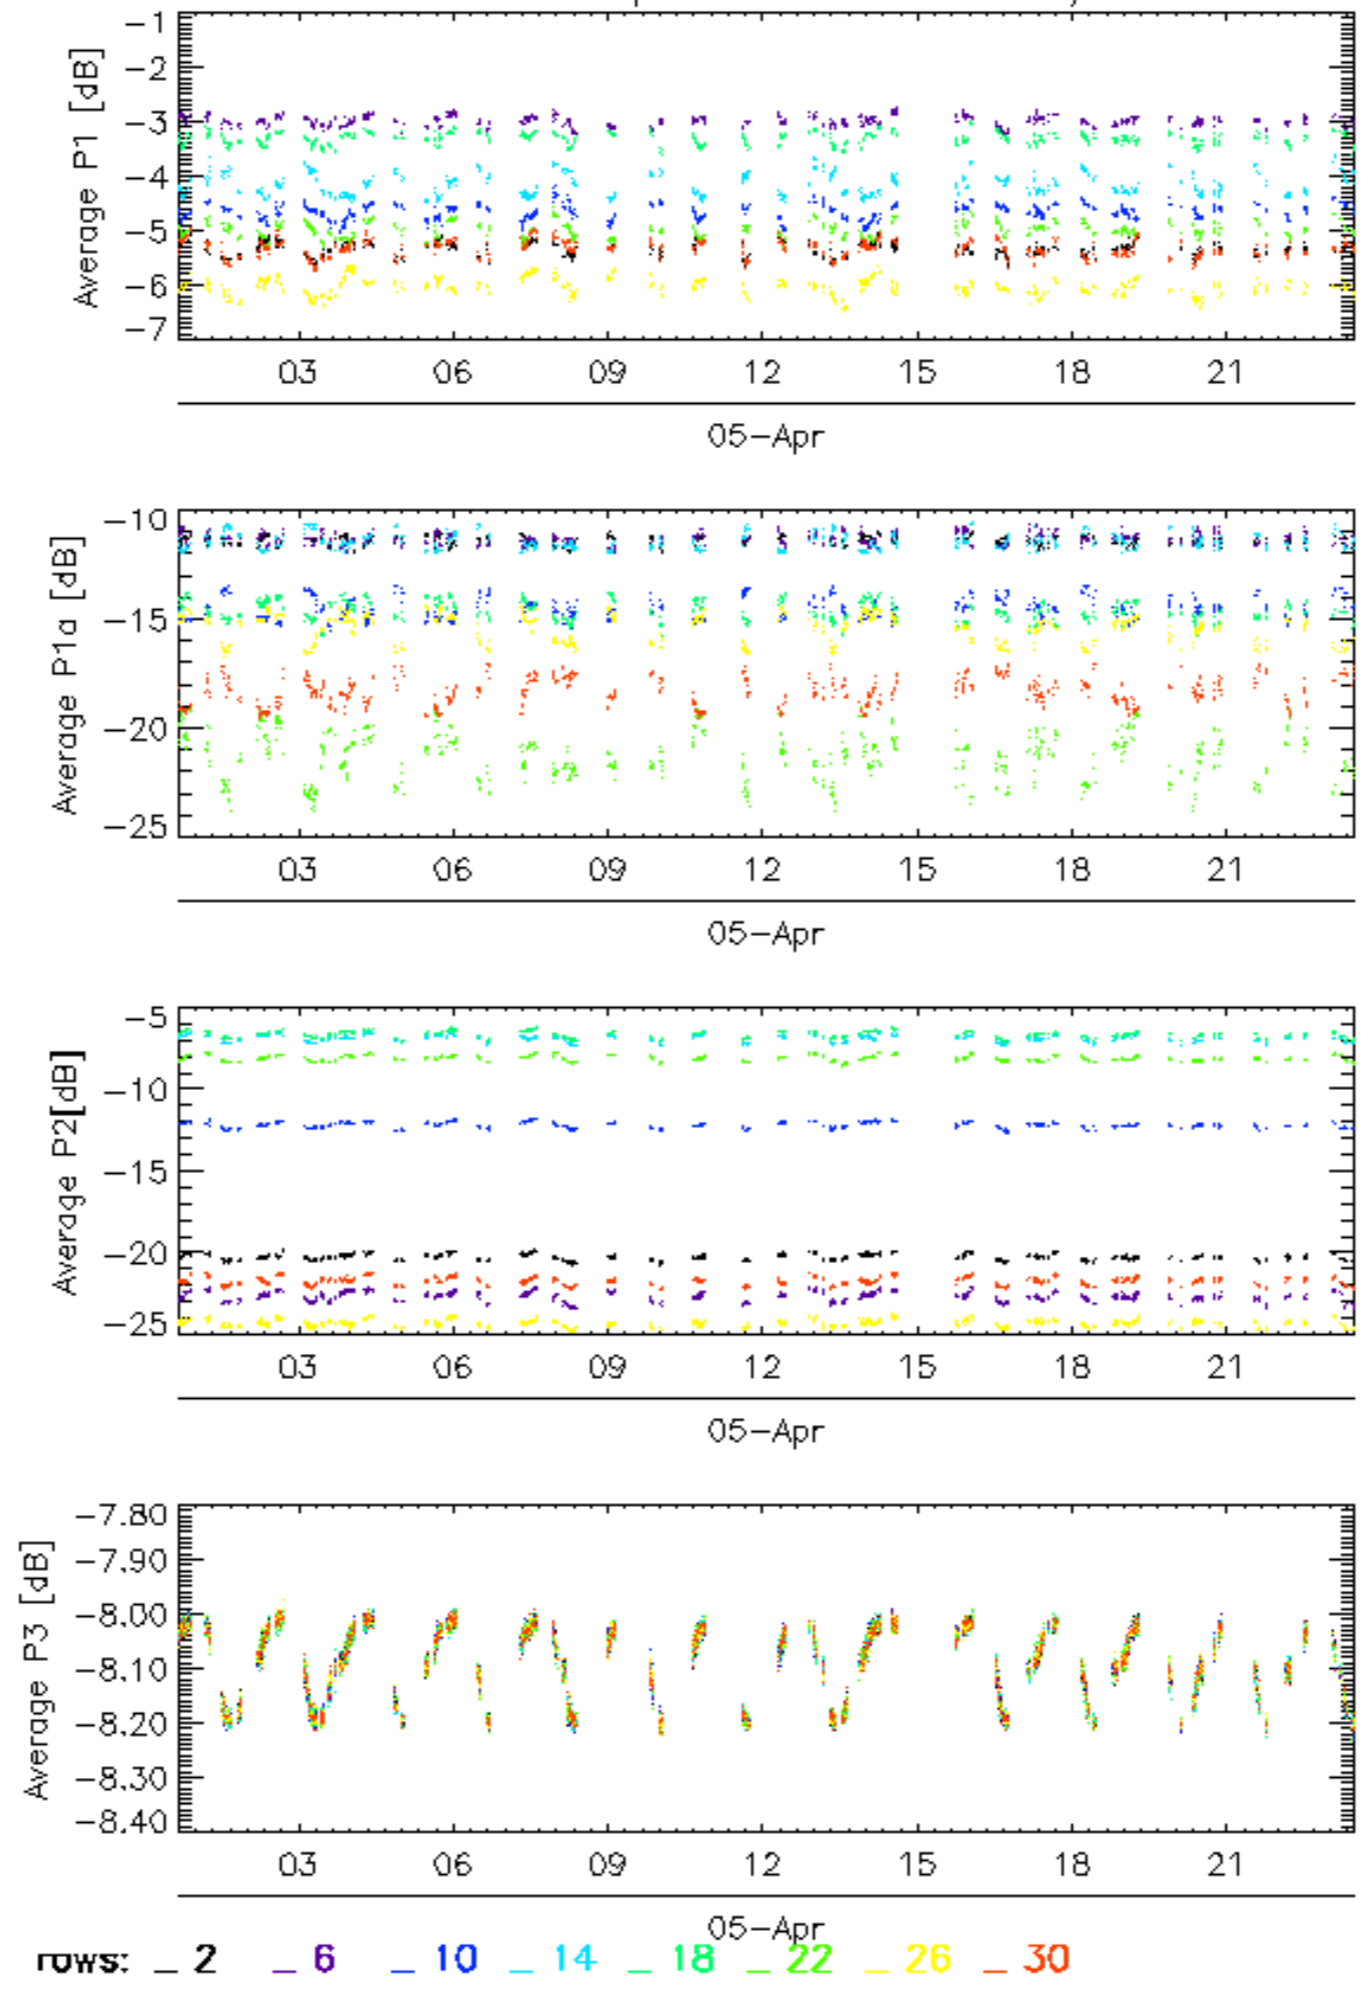





Calibration pulses for GM1 SS3 H/H

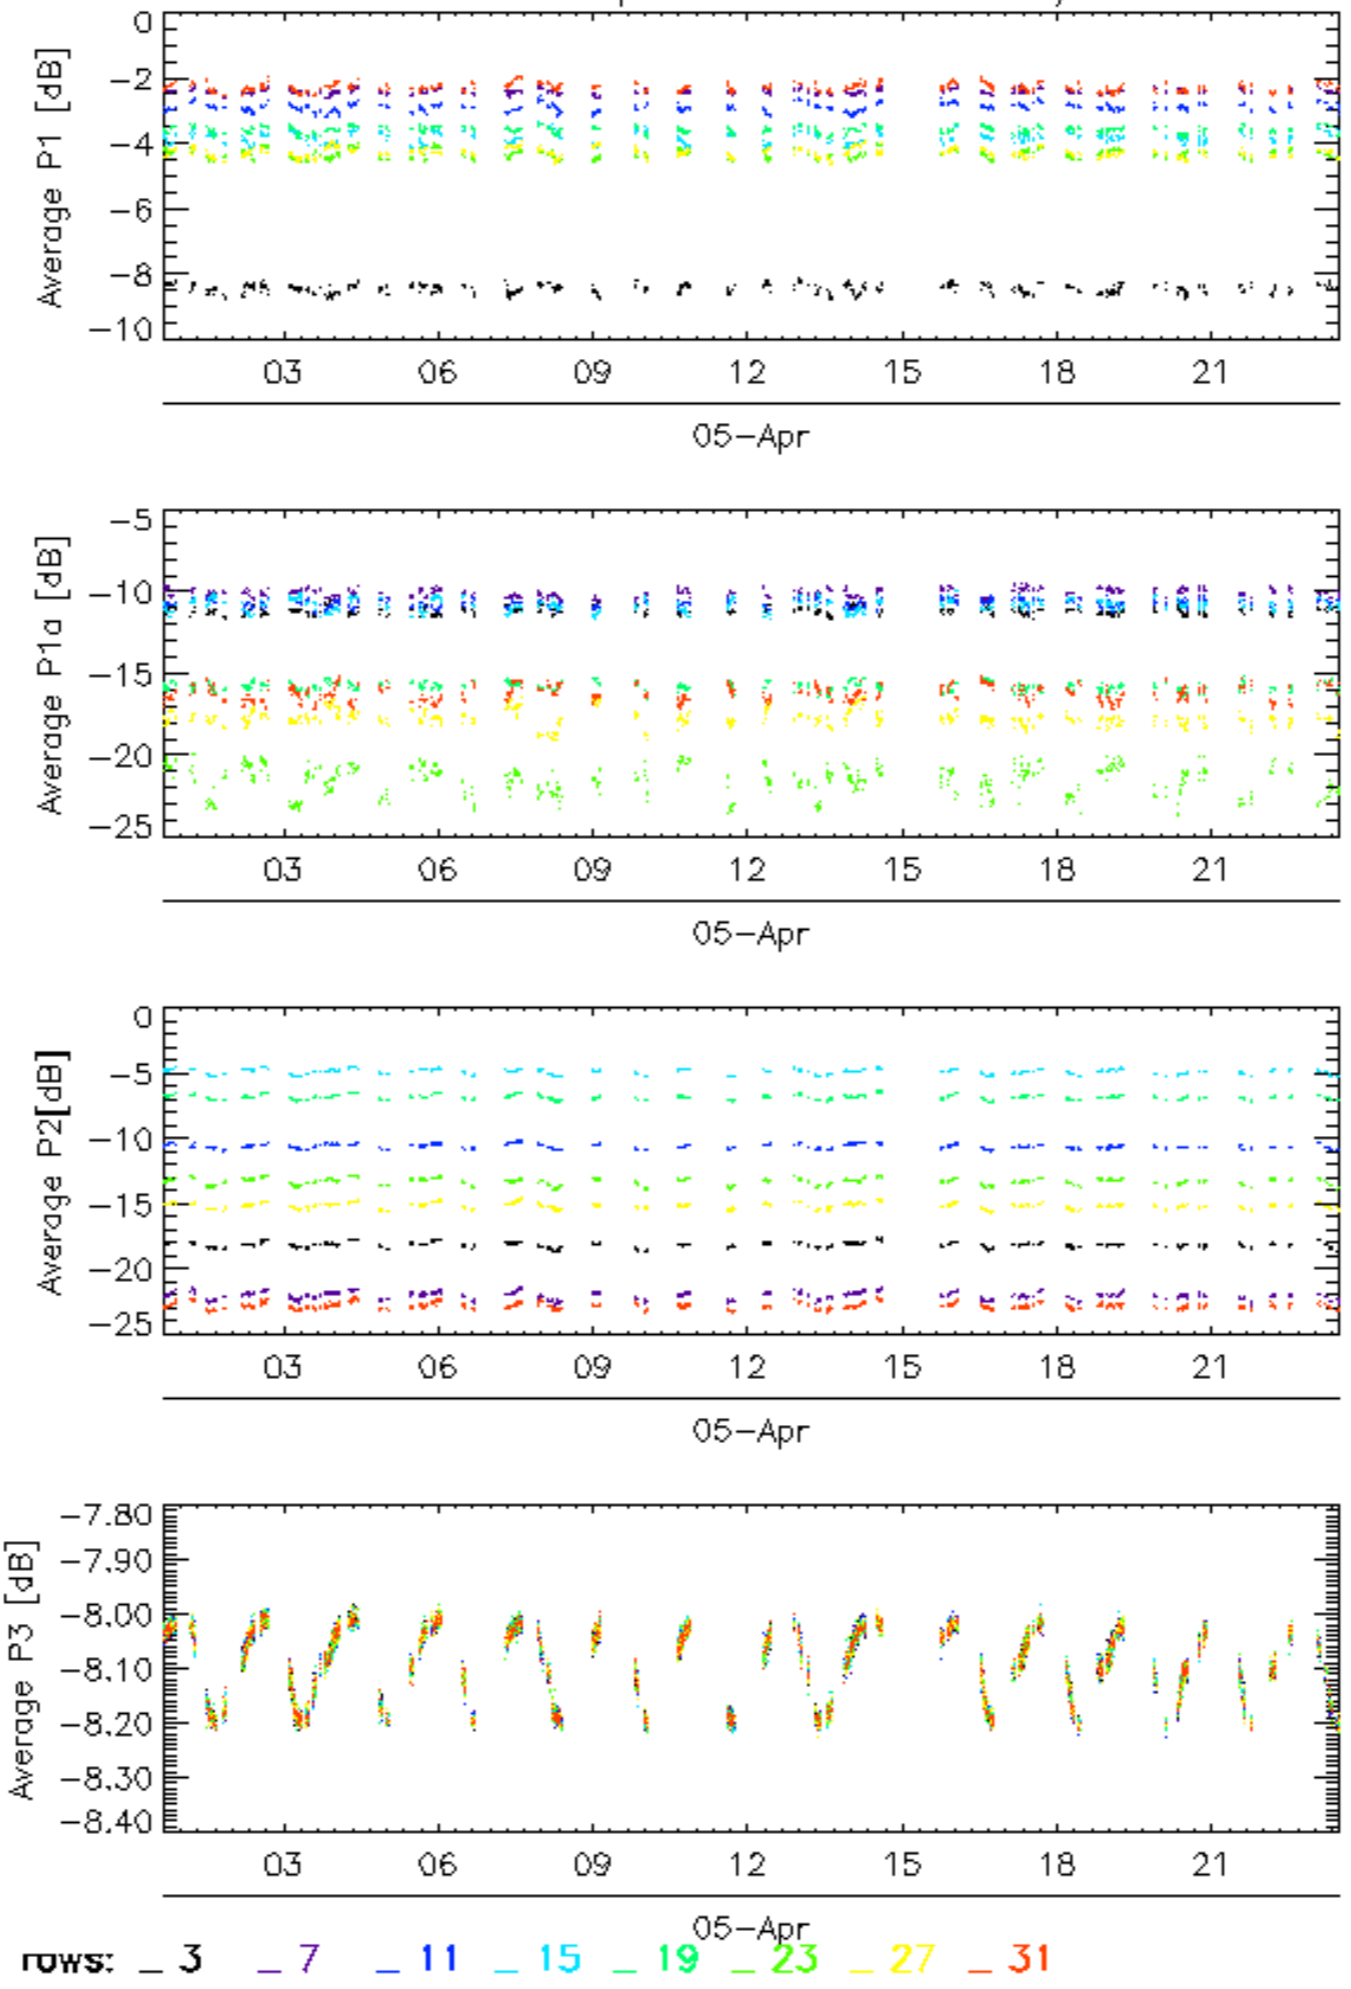

### Calibration pulses for GM1 SS3 H/H

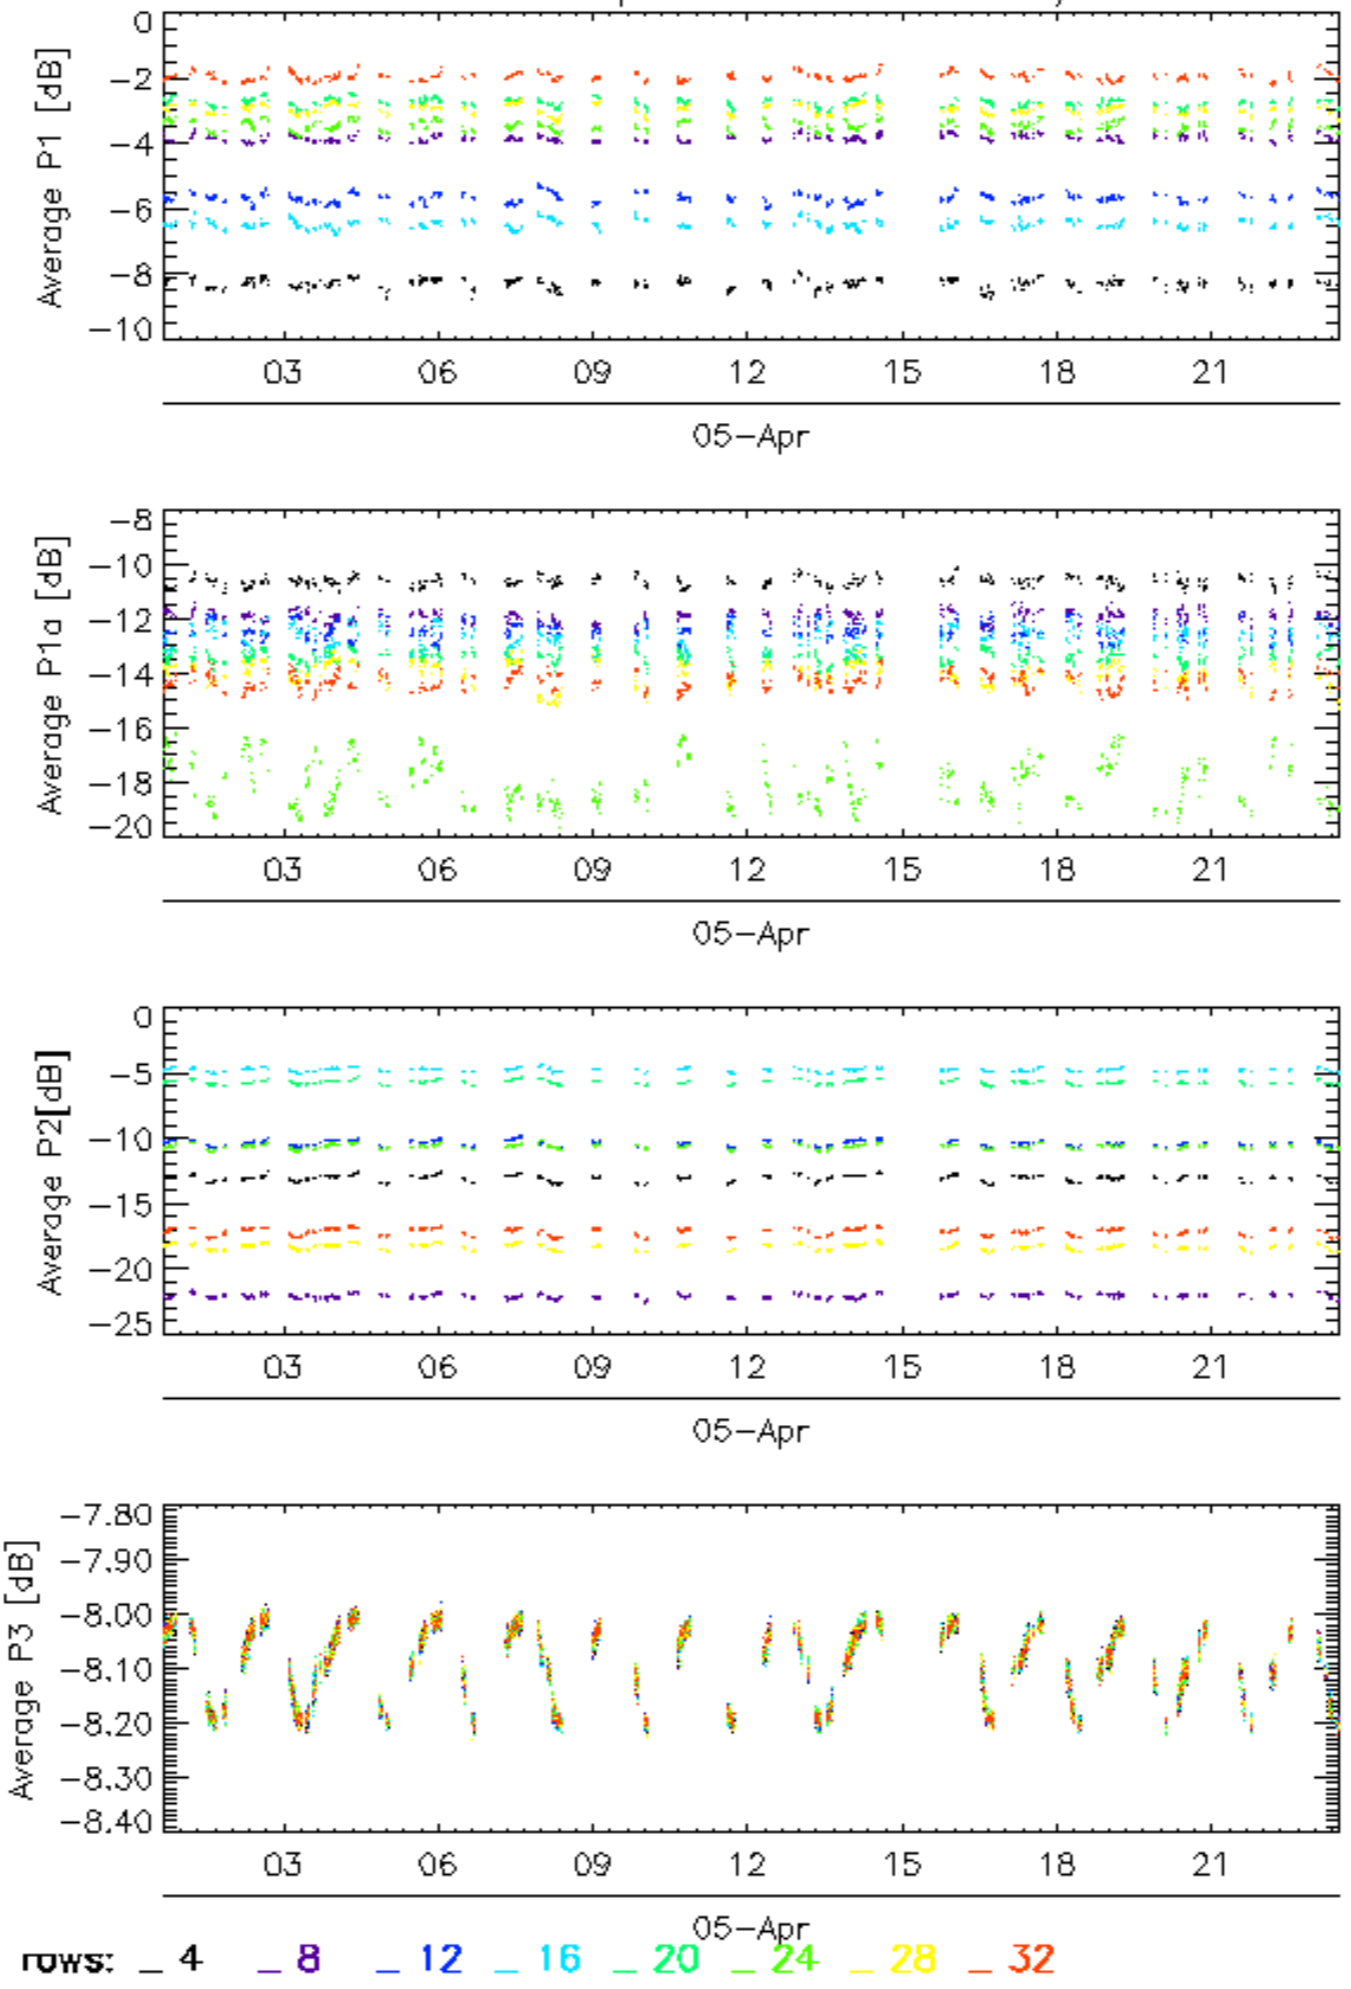


### Calibration pulses for WVS IS2 V/V

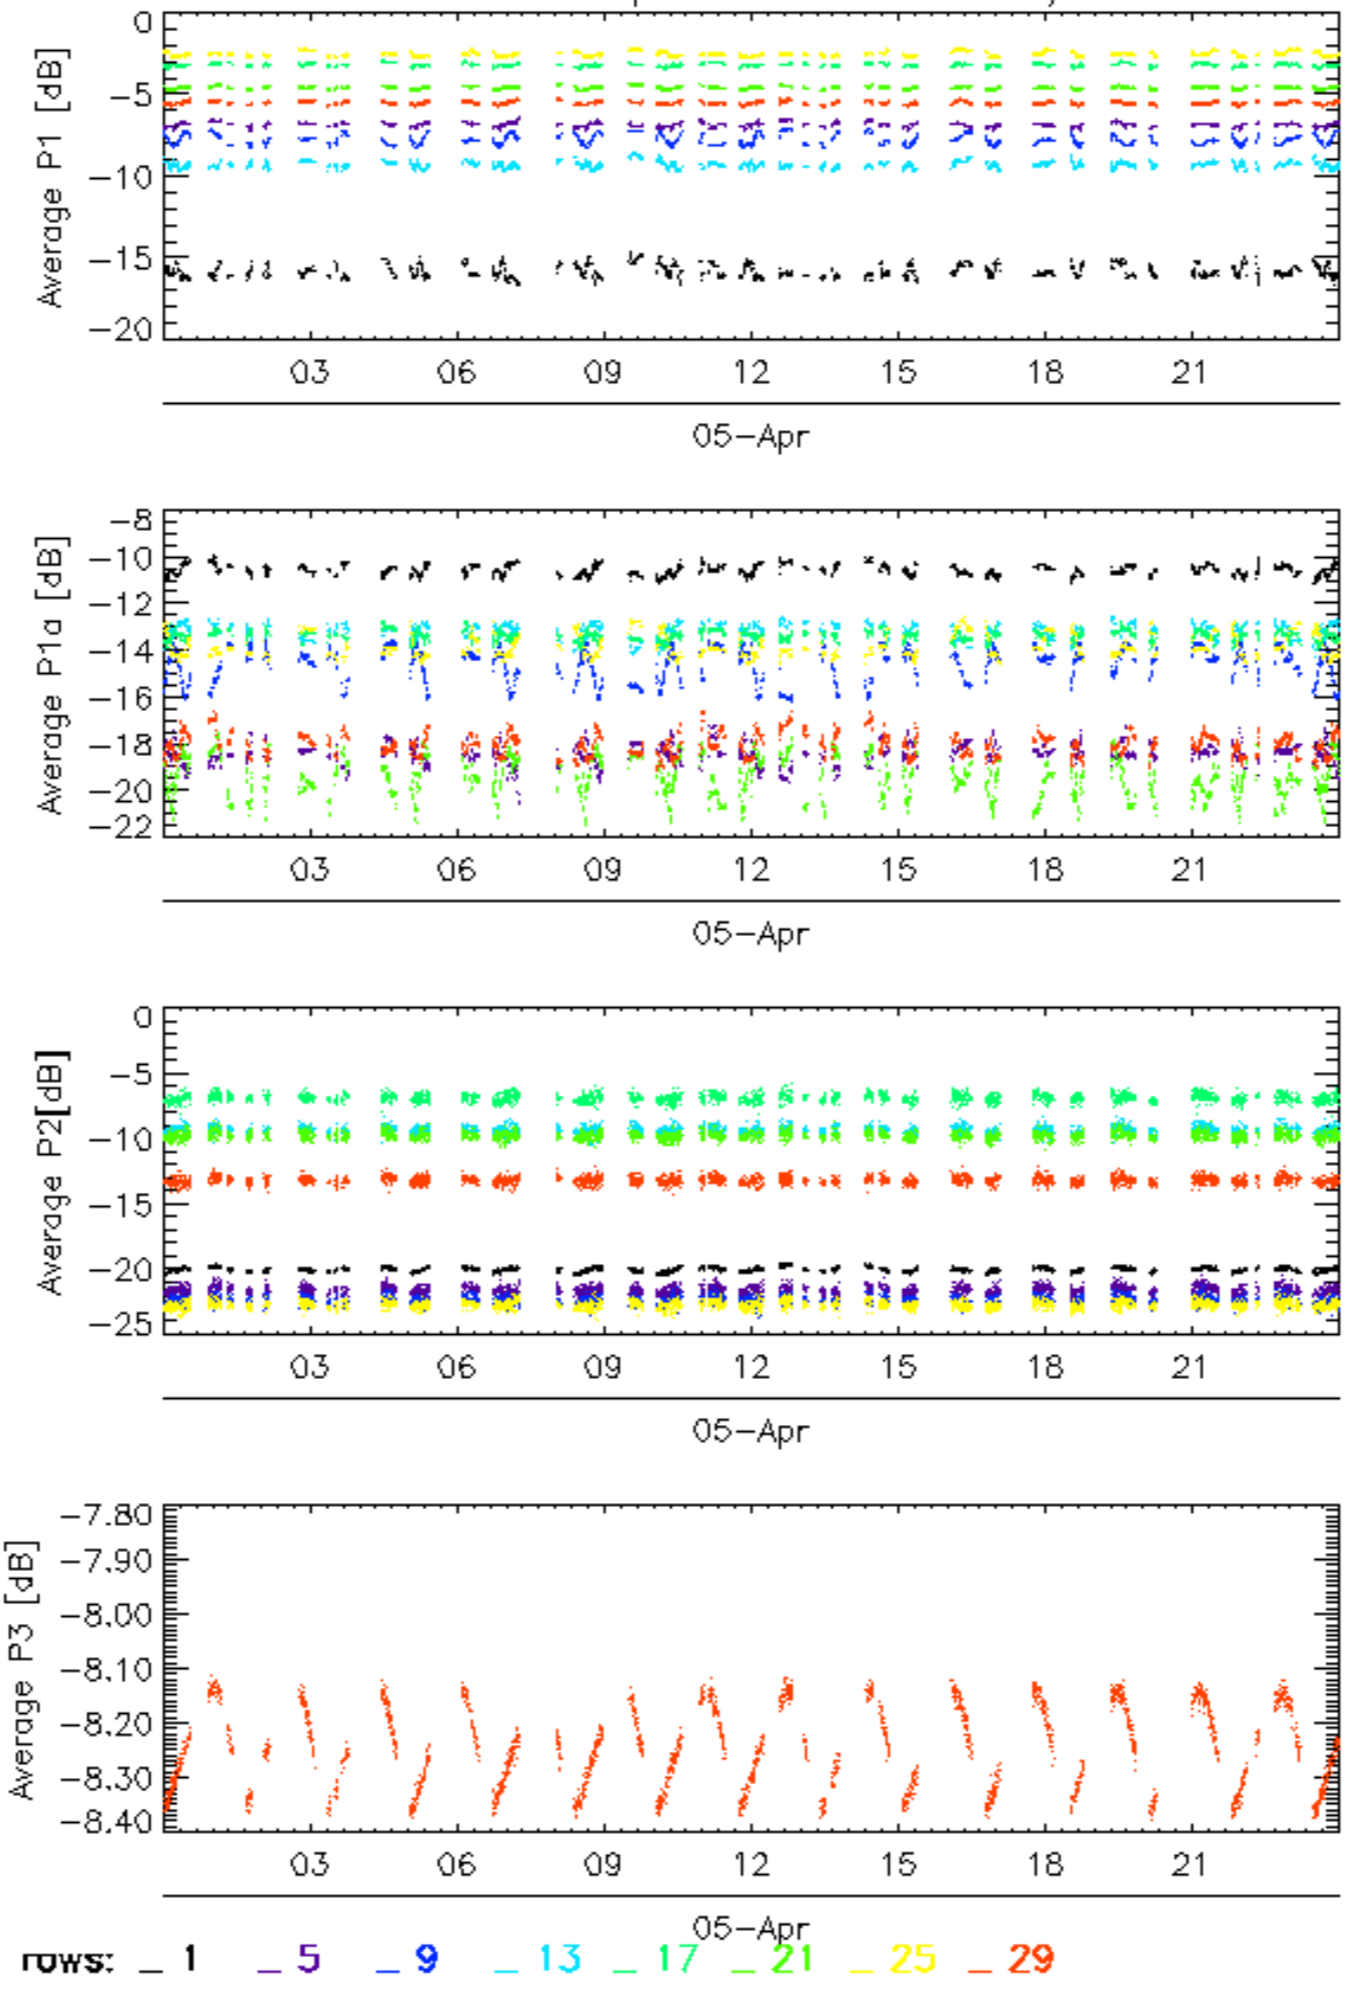





Calibration pulses for WVS IS2 V/V

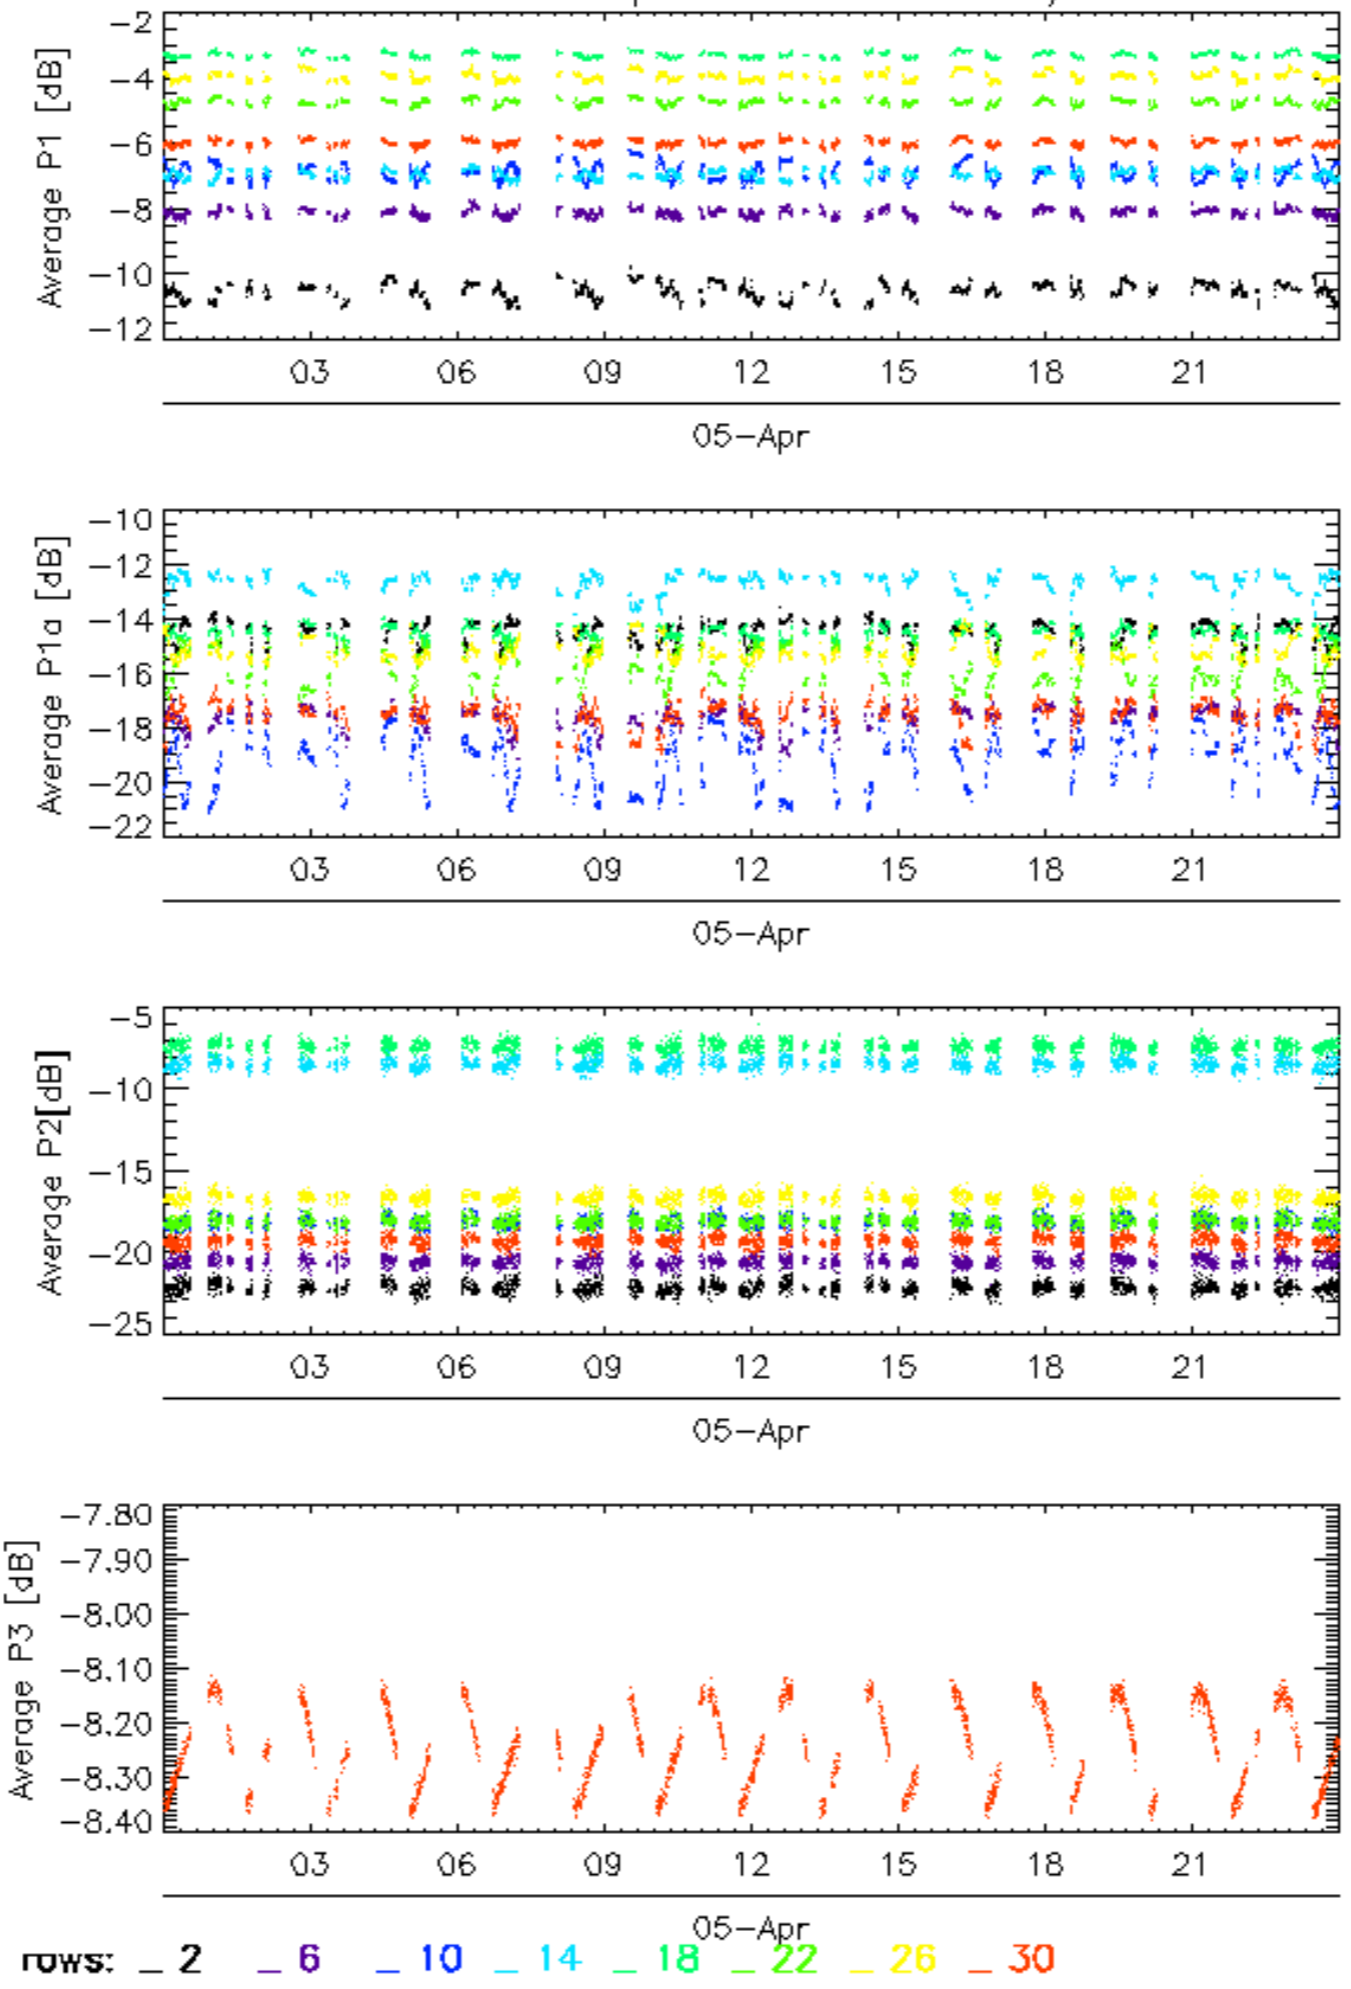


### Calibration pulses for WVS IS2 V/V

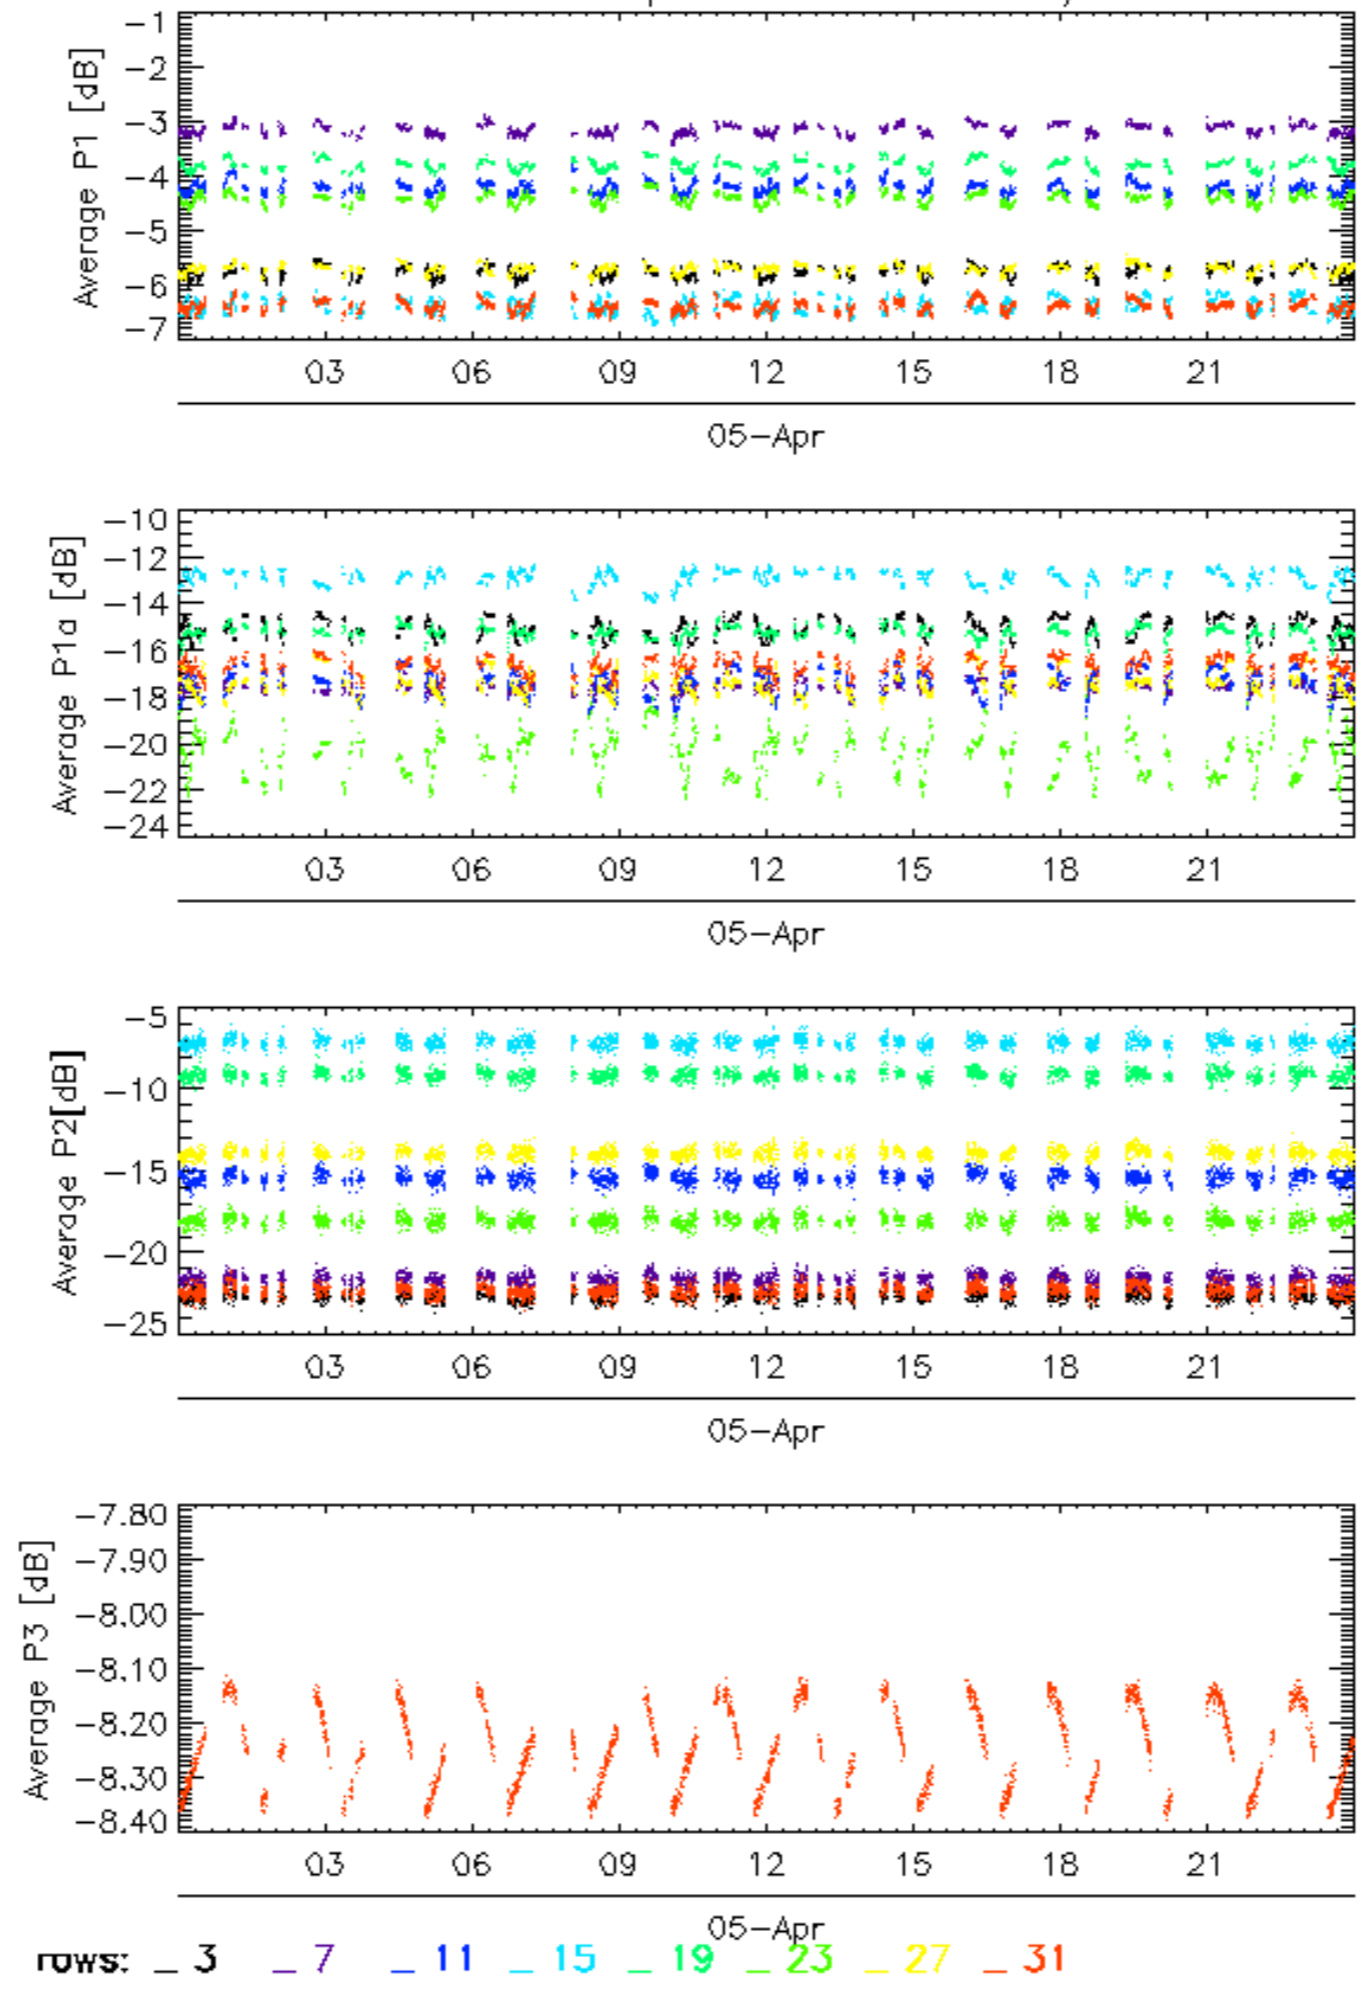




Calibration pulses for WVS IS2 V/V

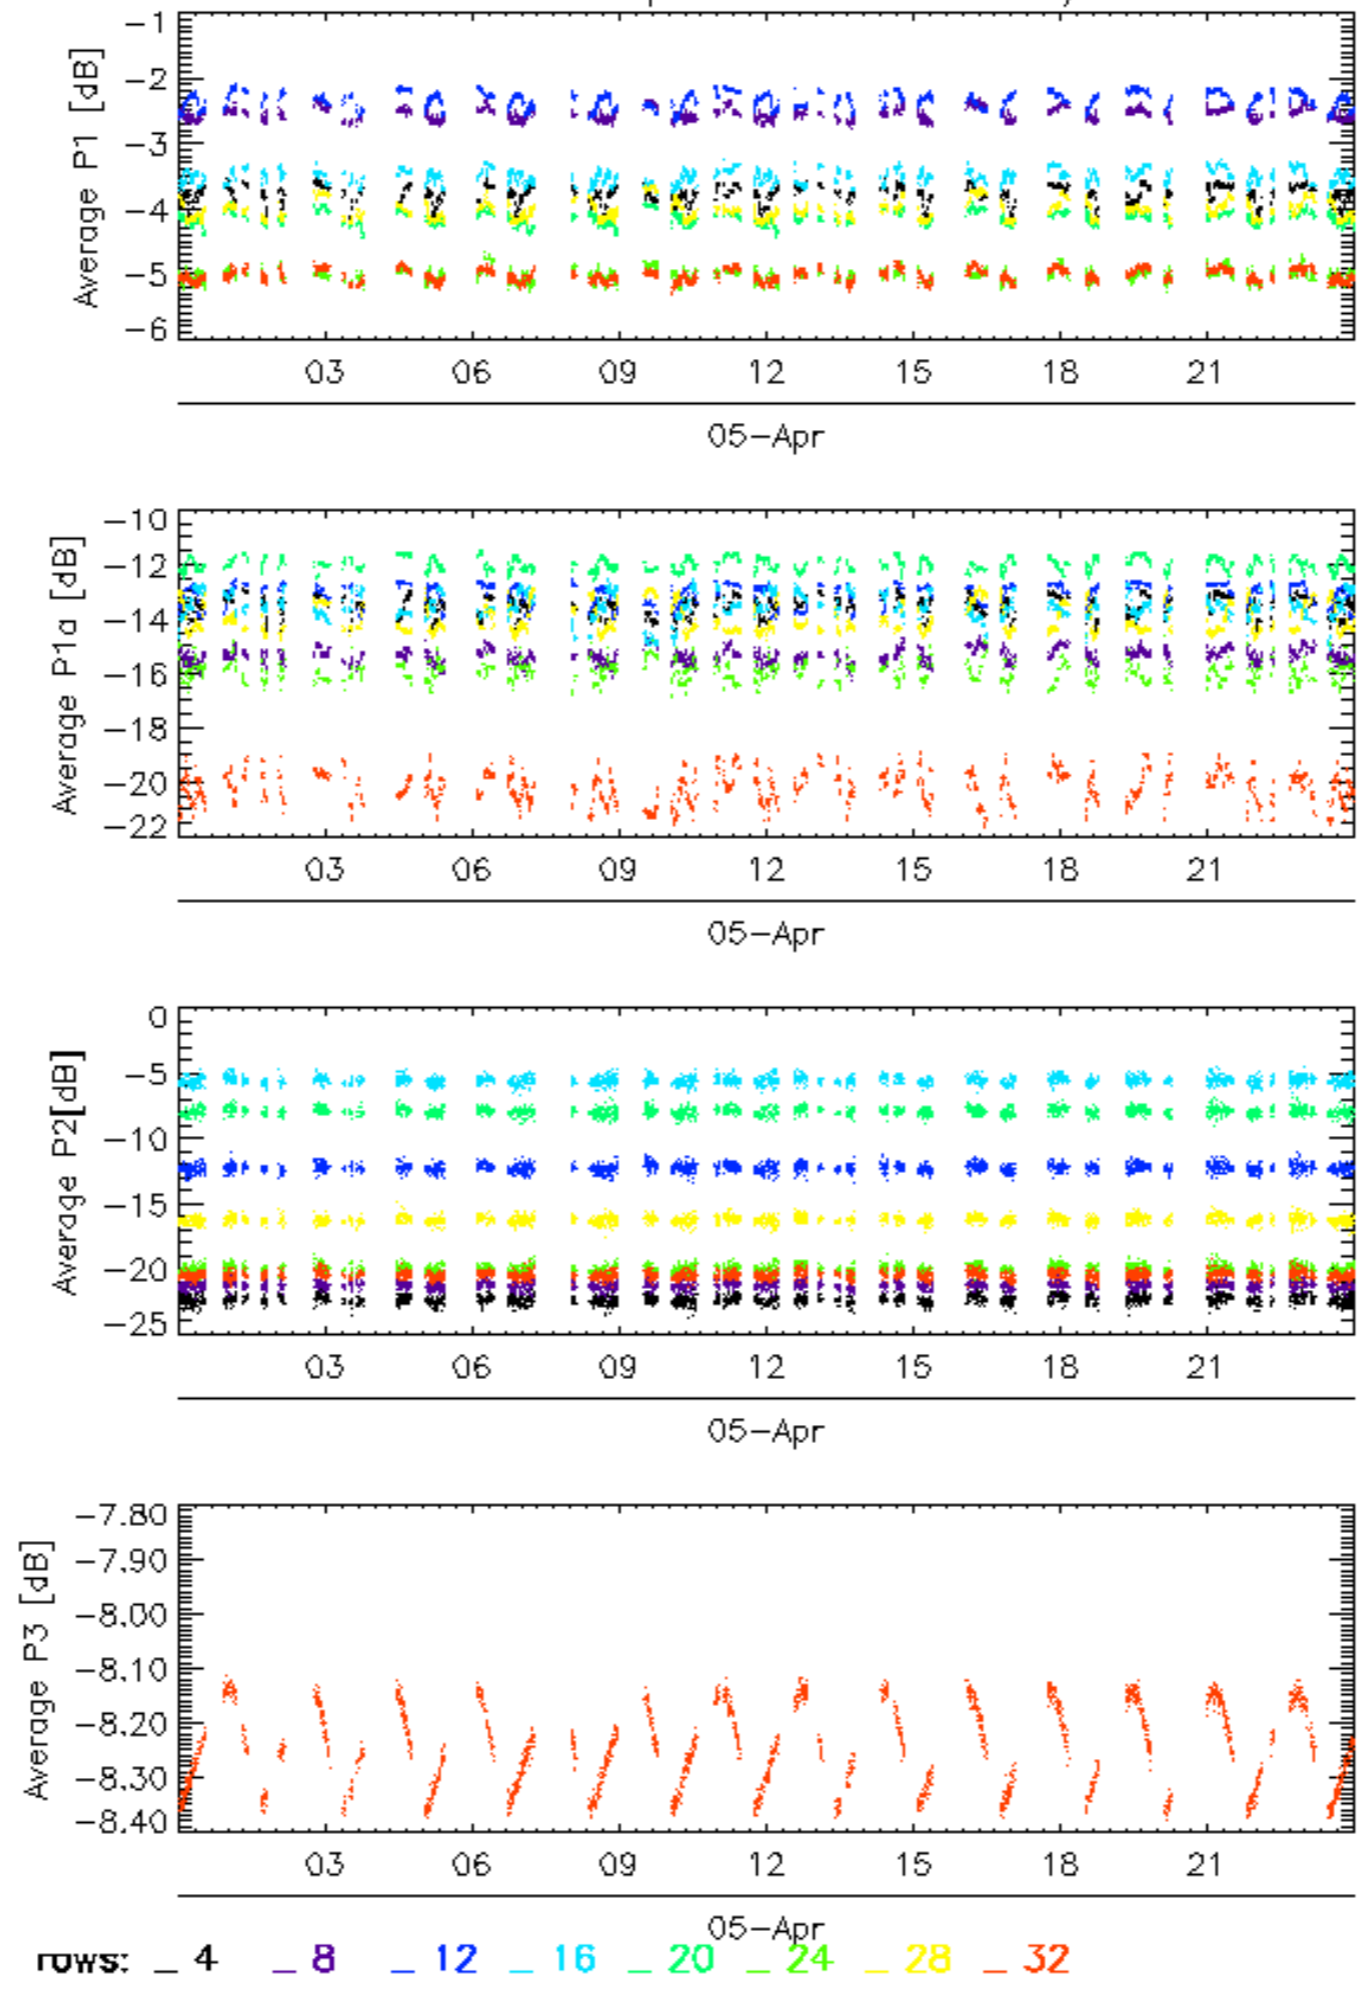






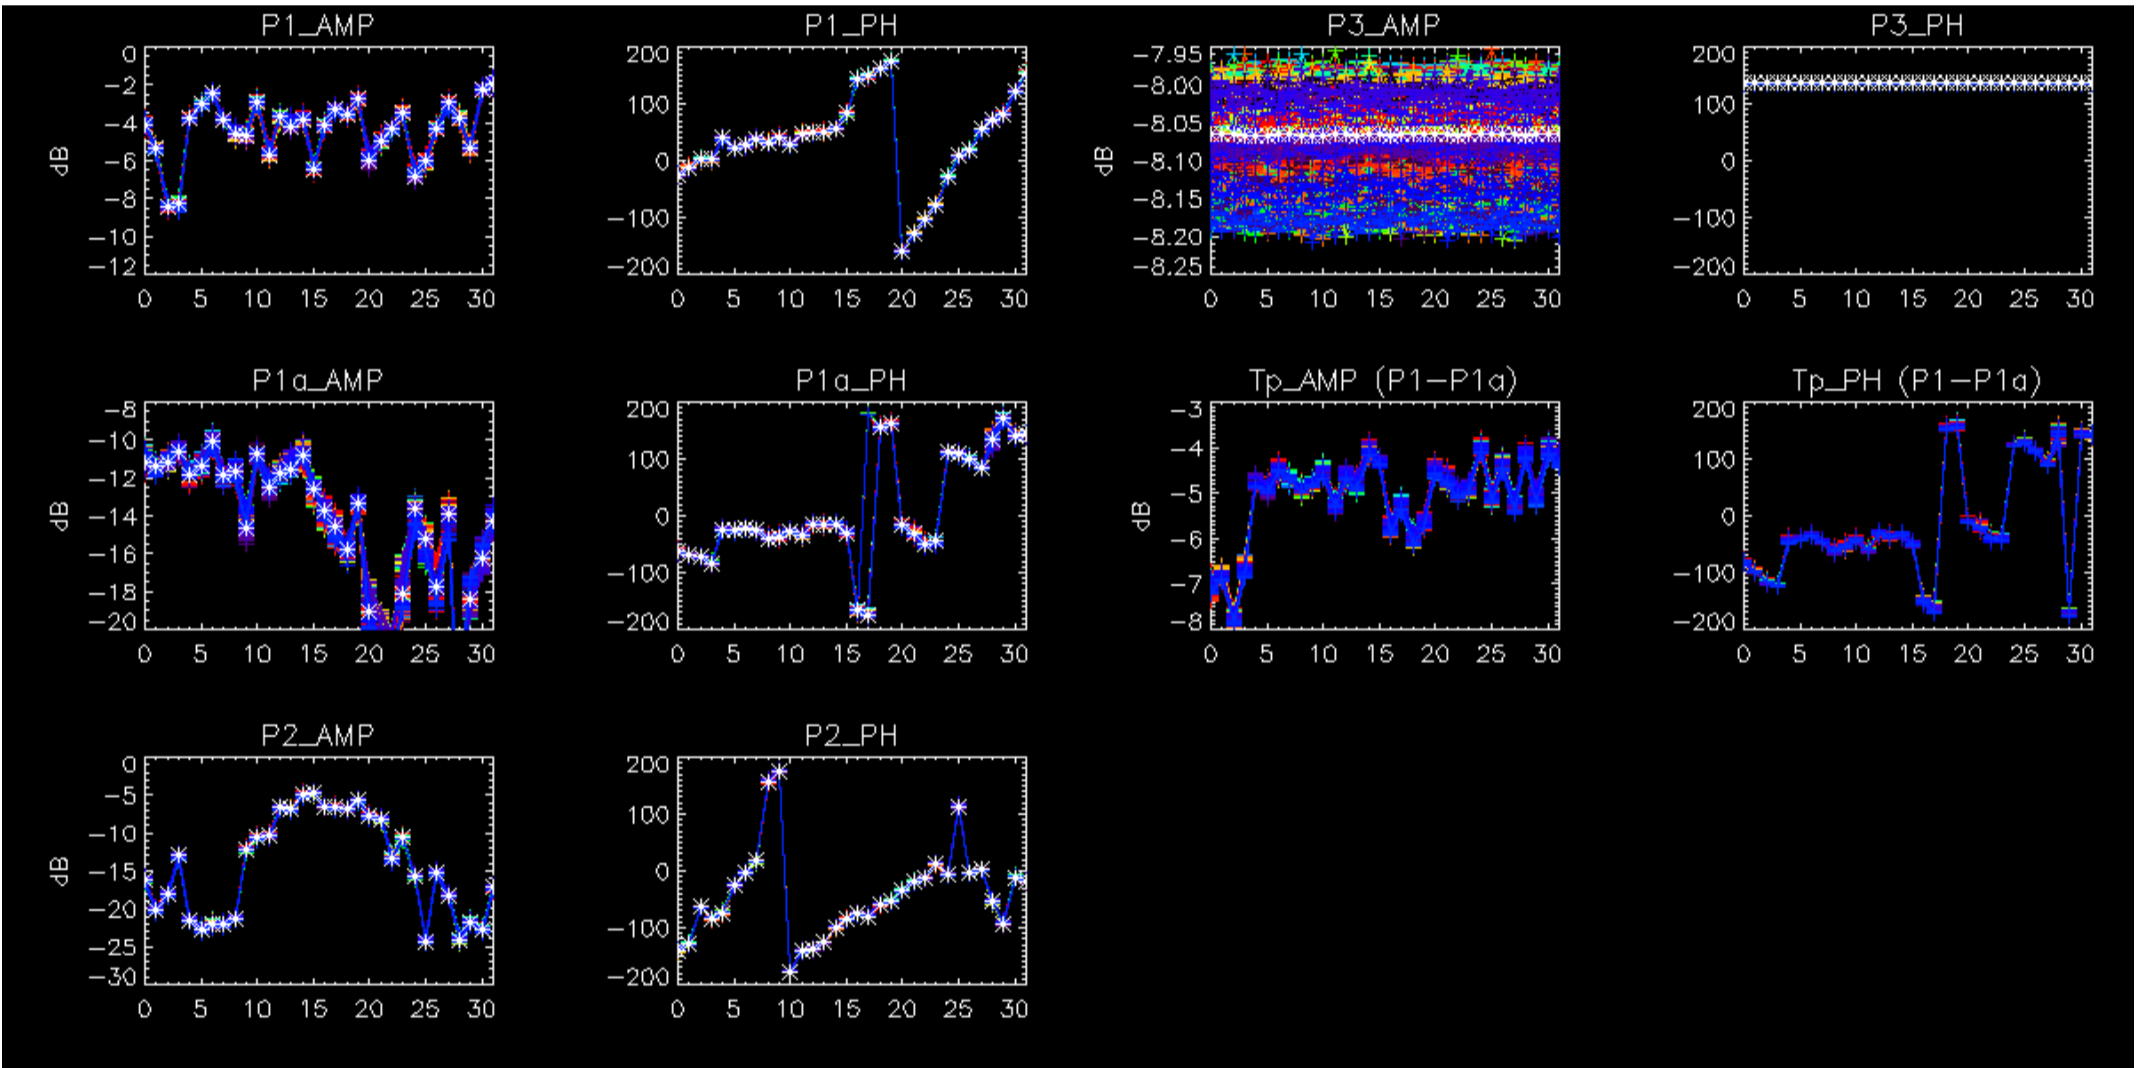



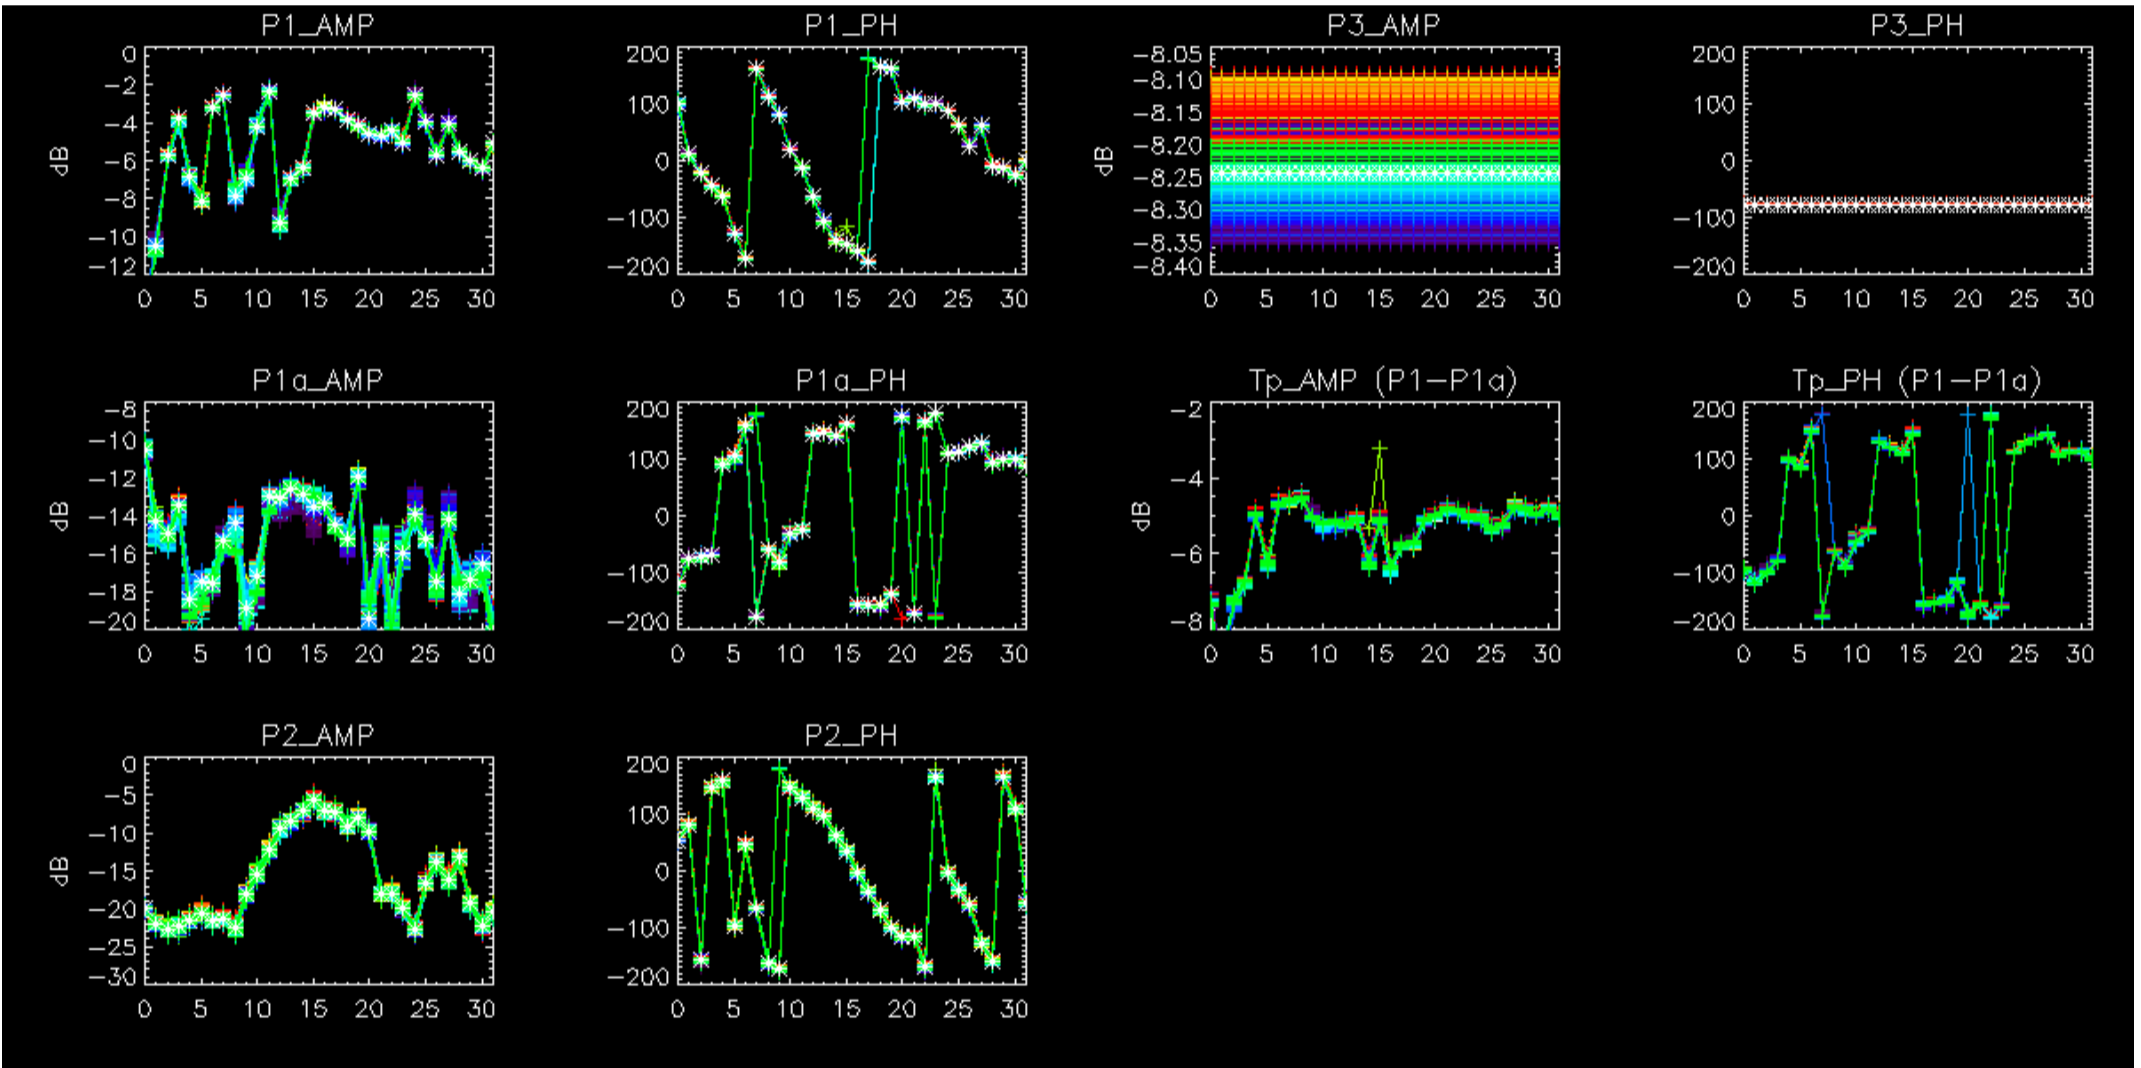


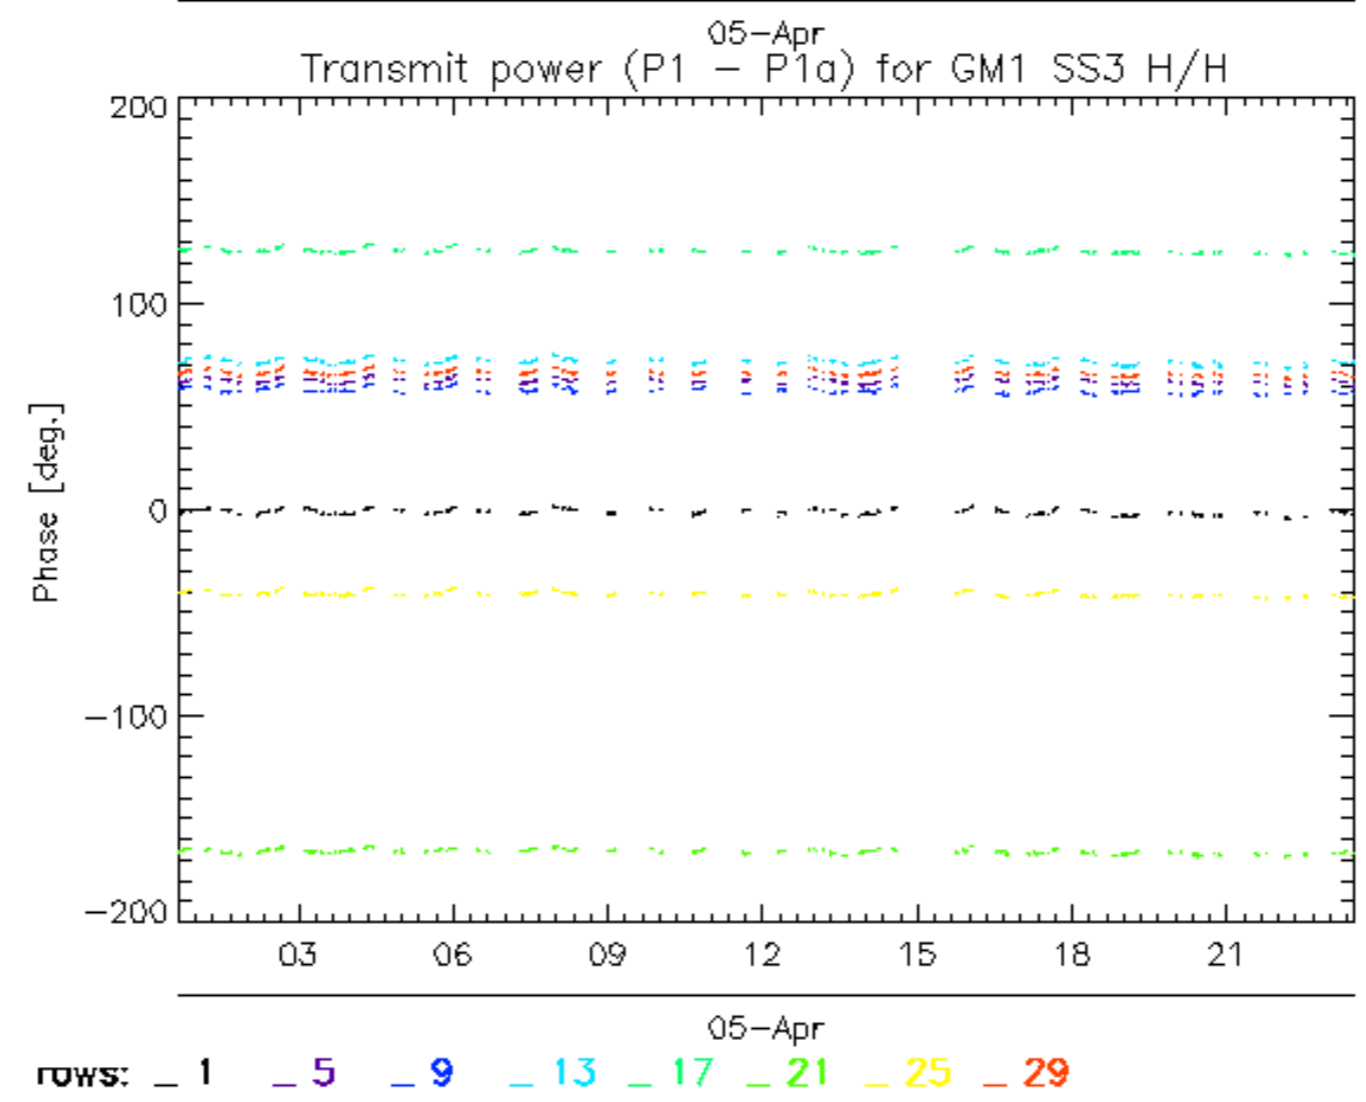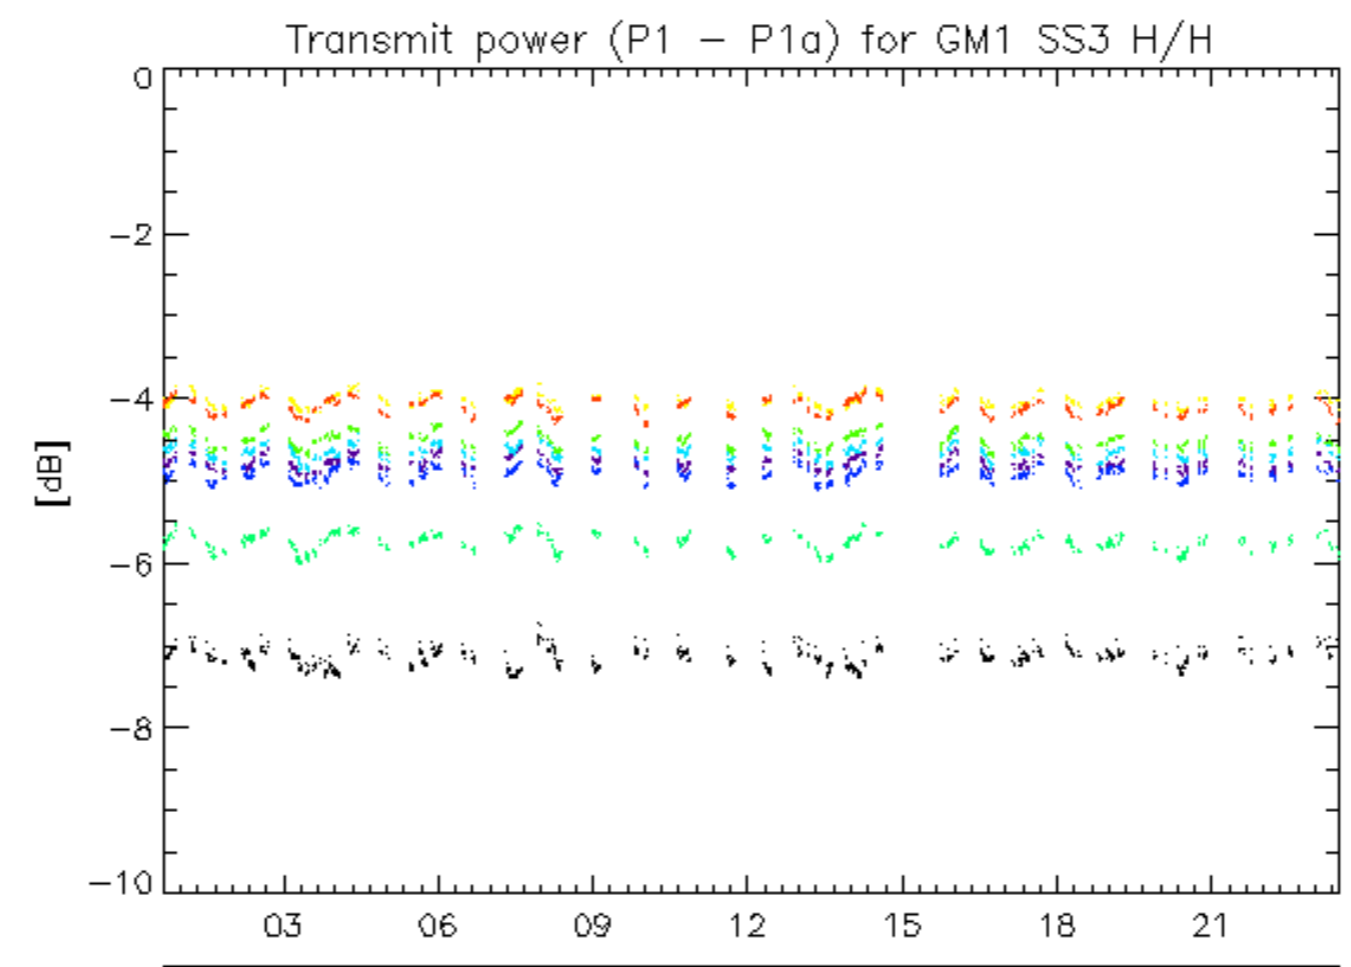





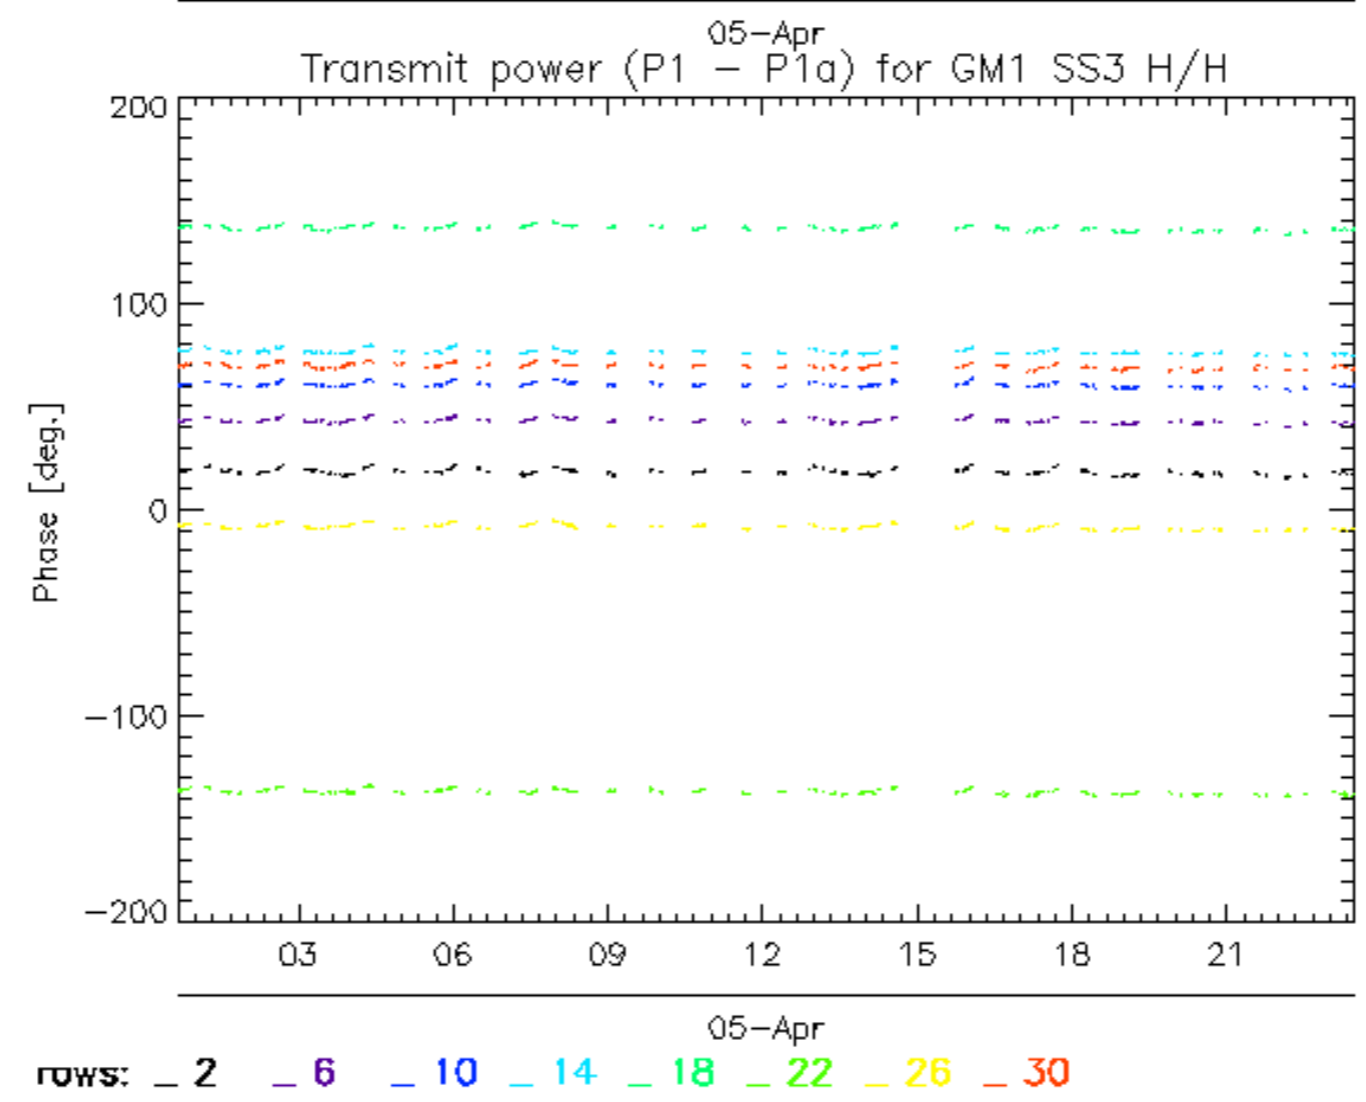
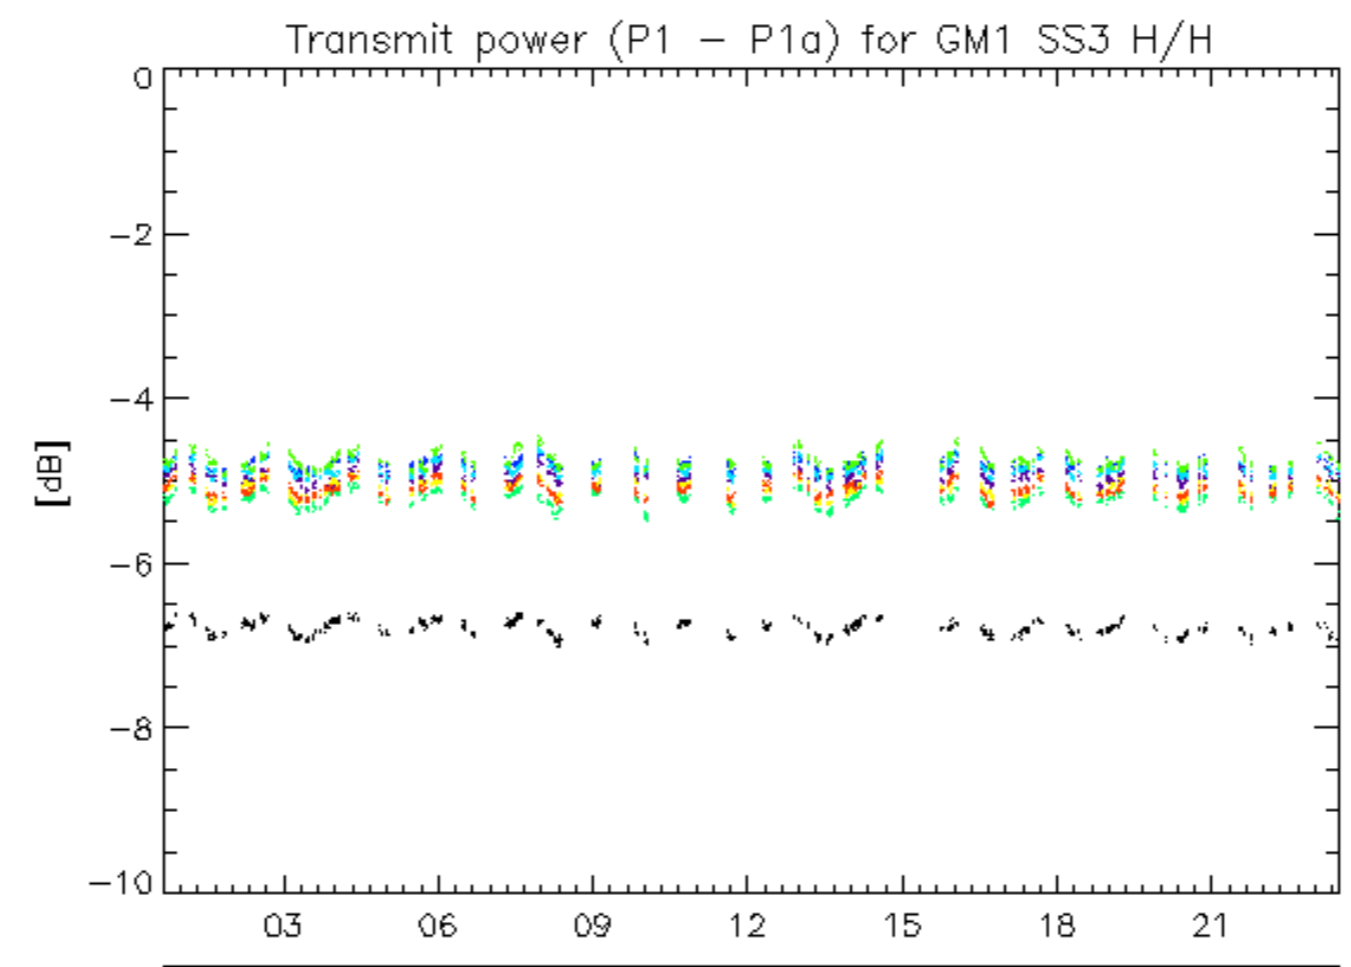


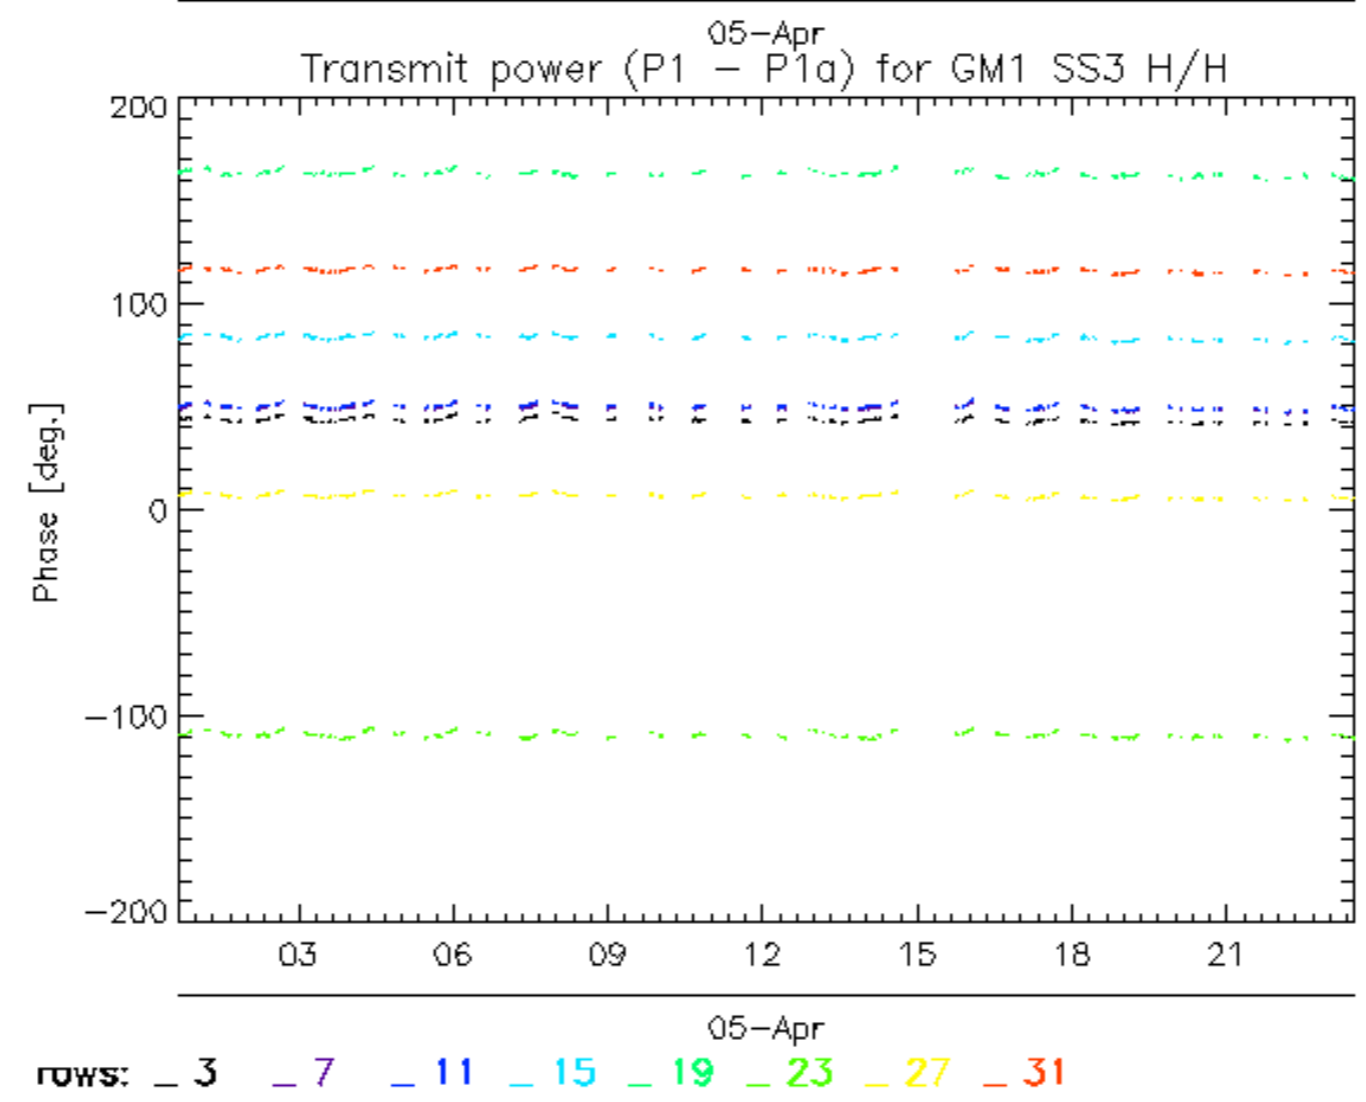
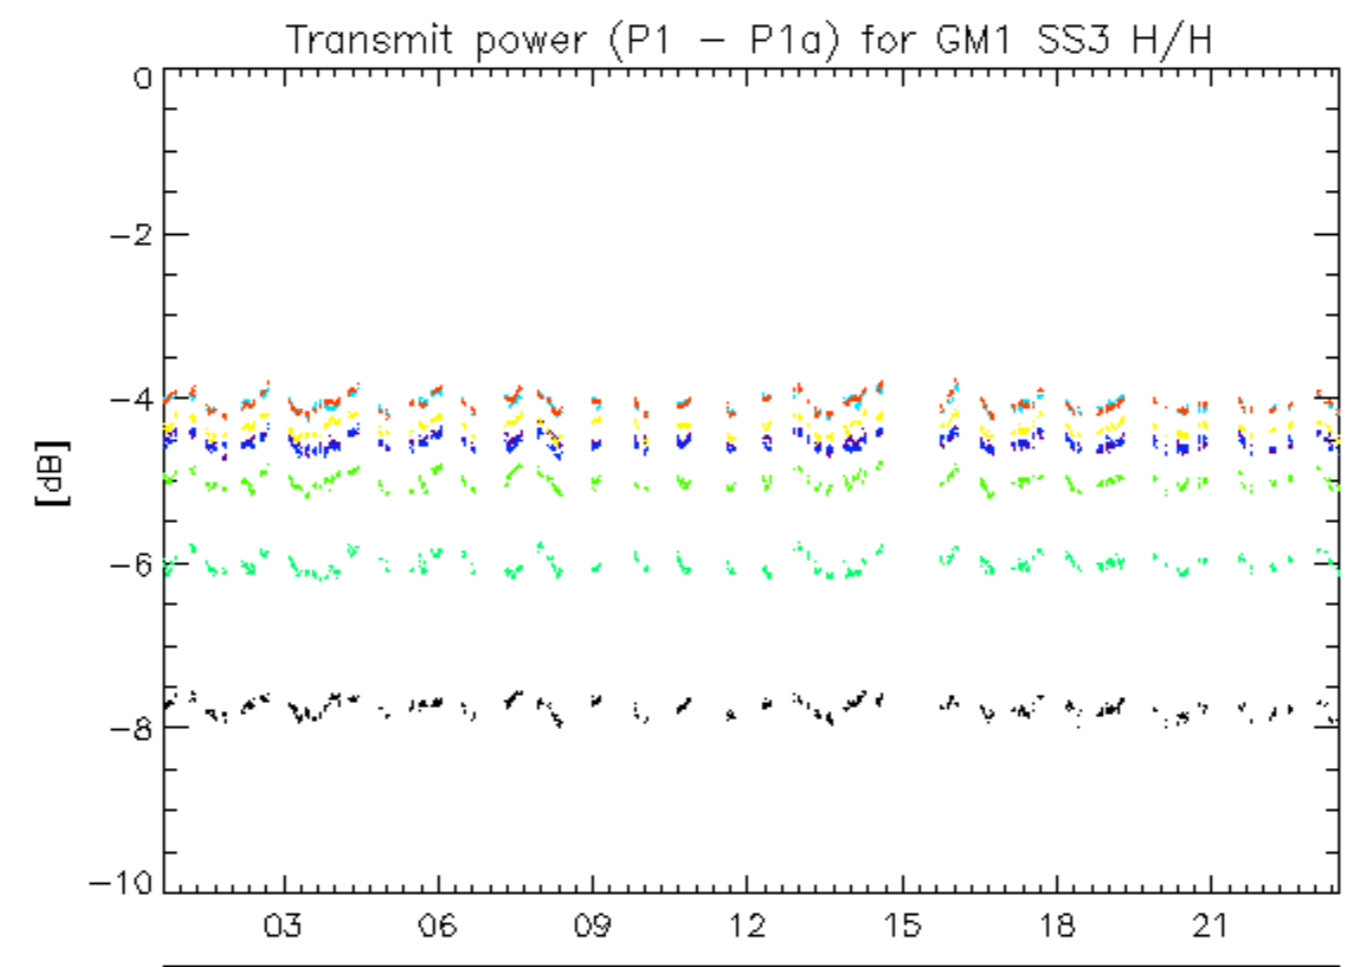


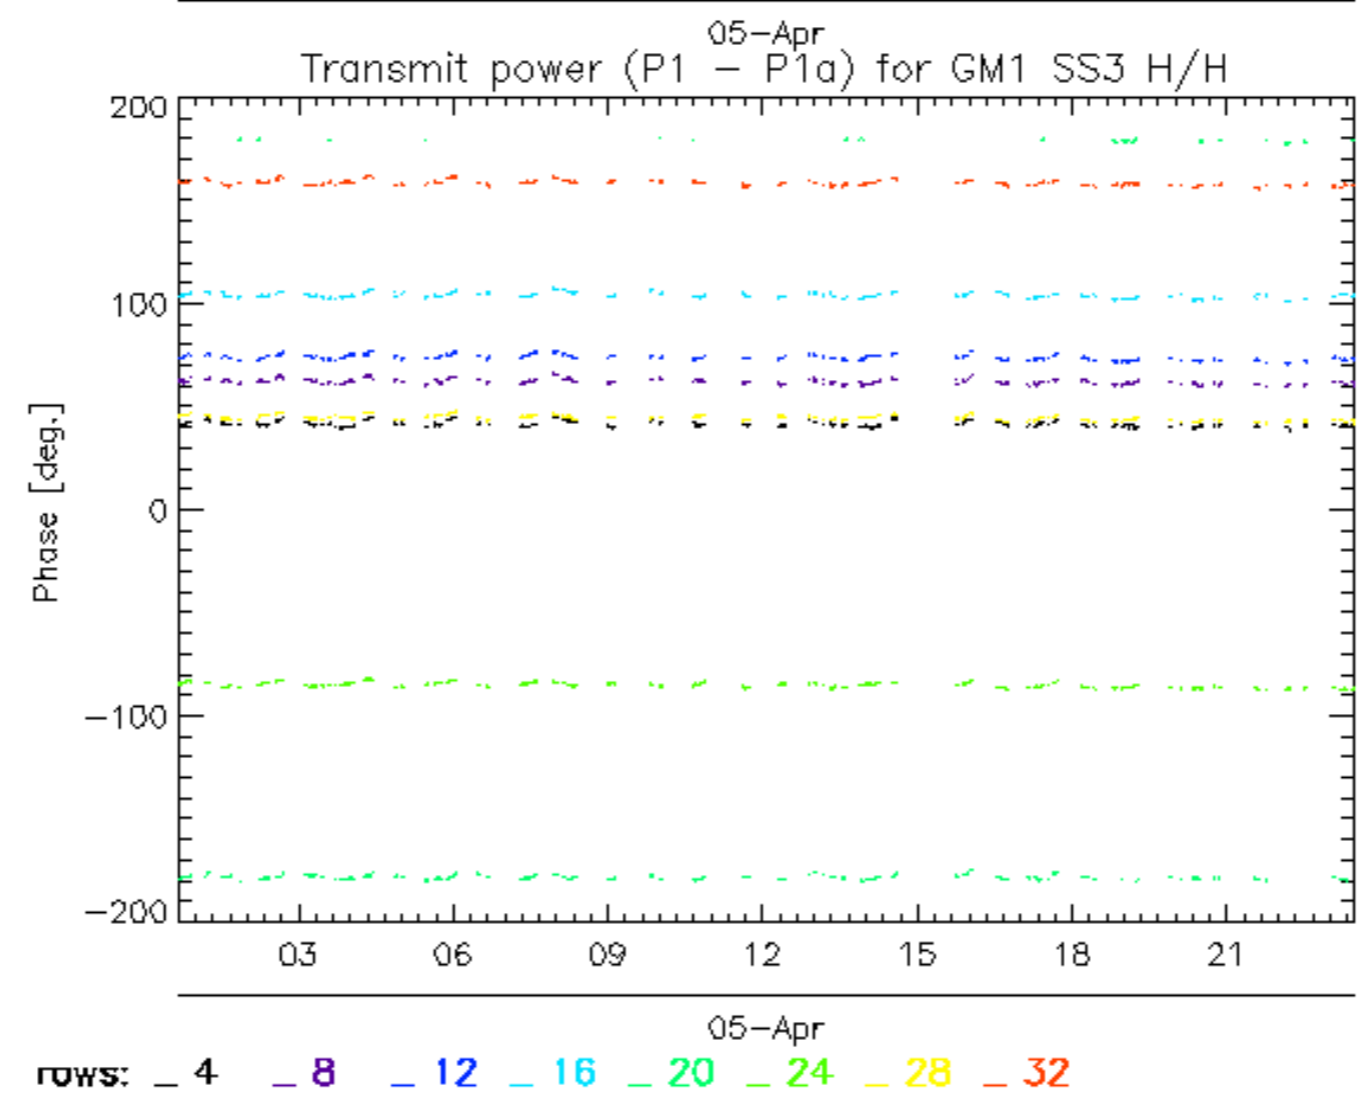
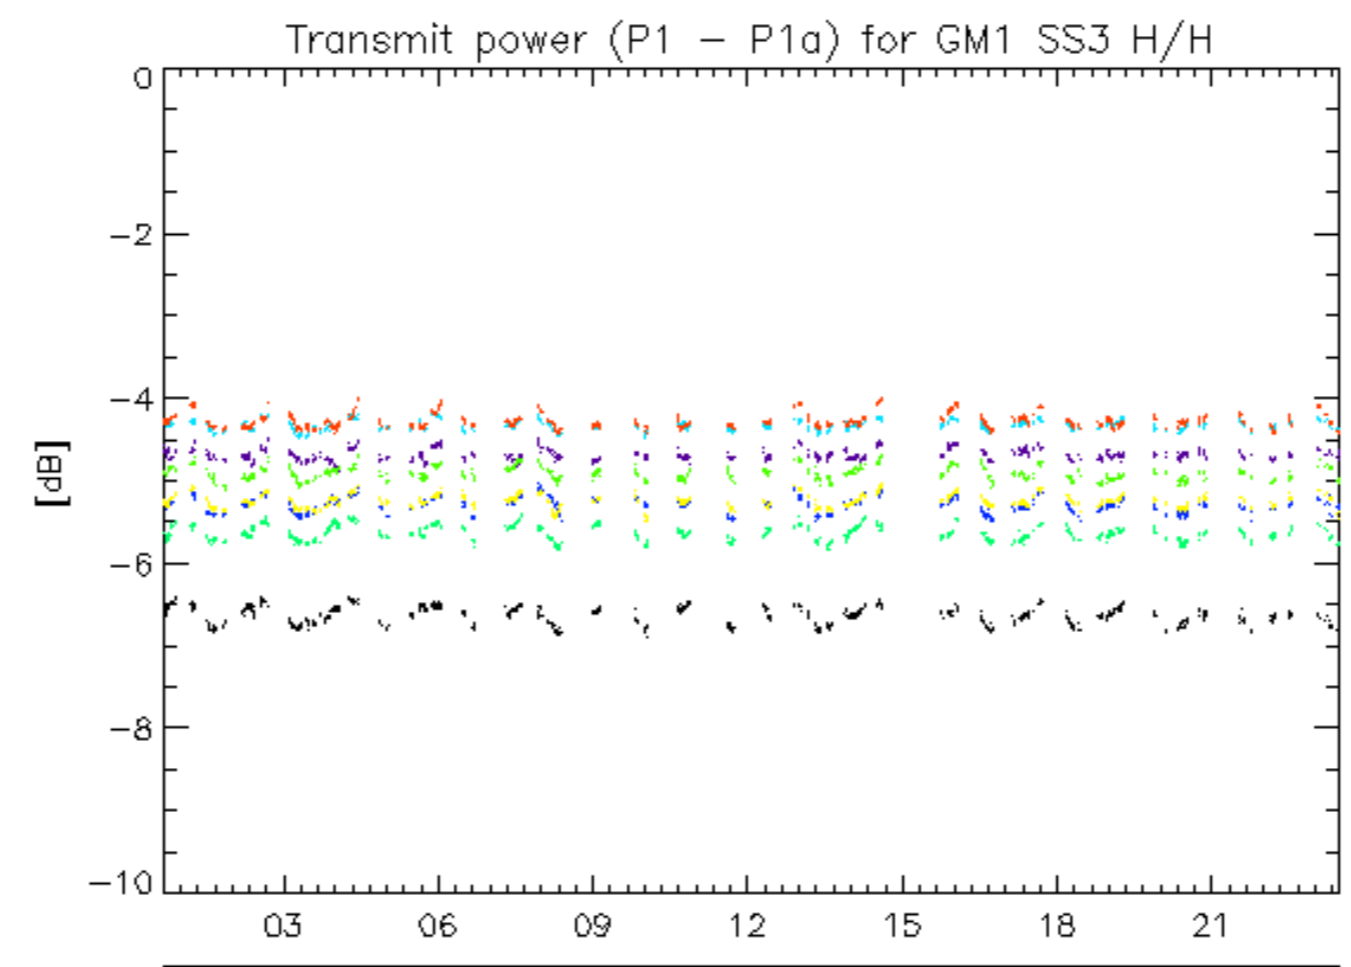




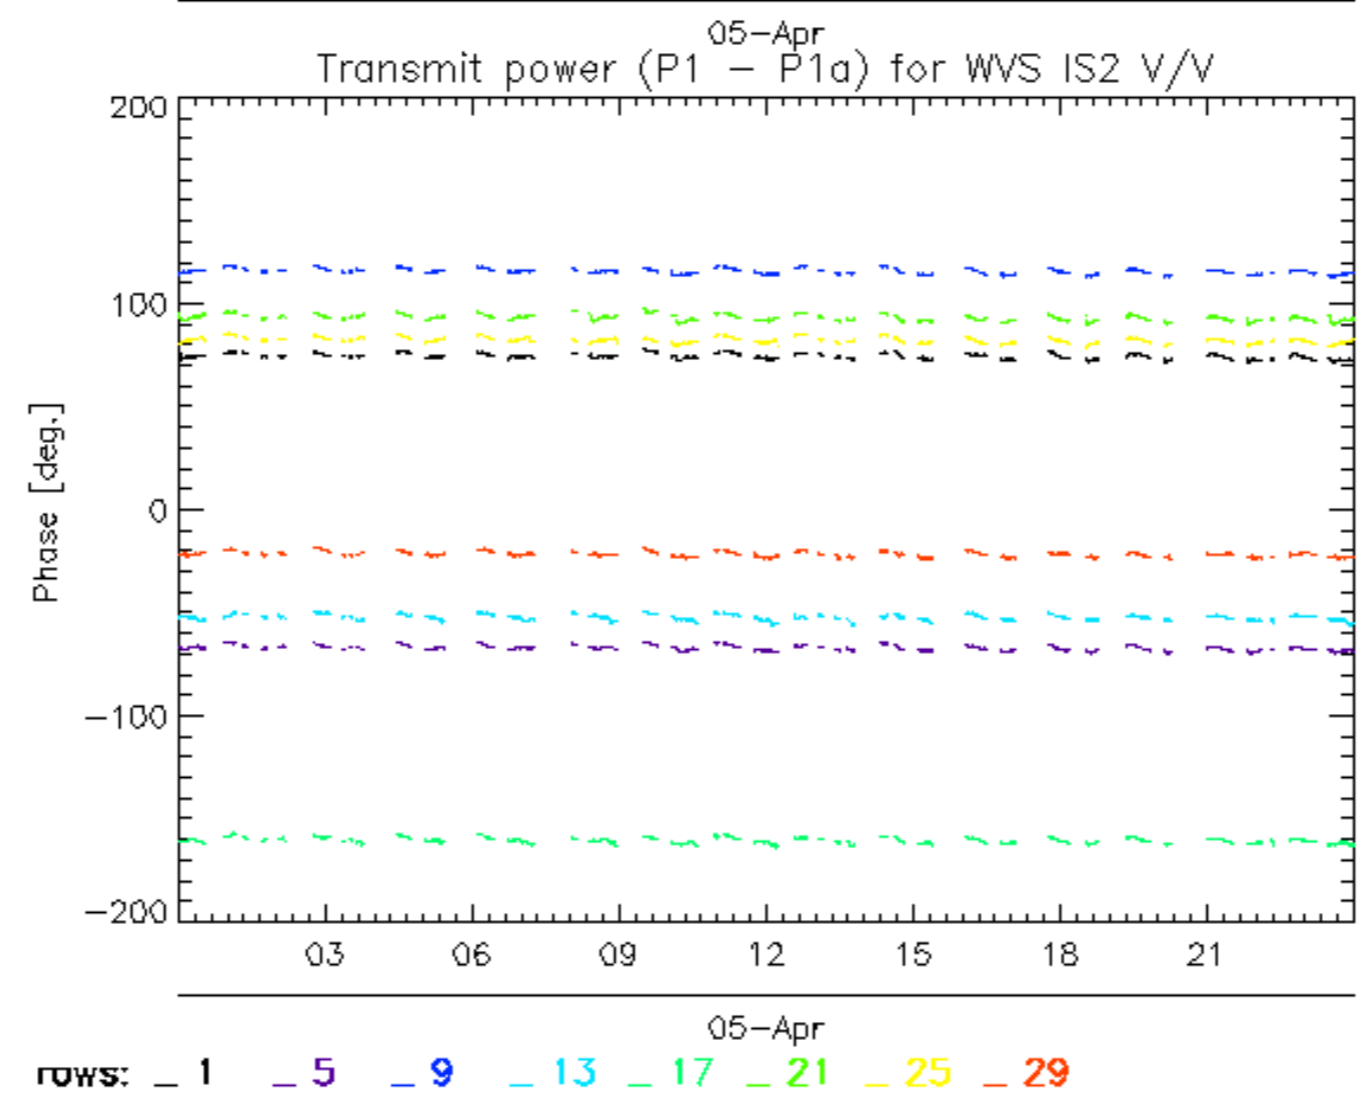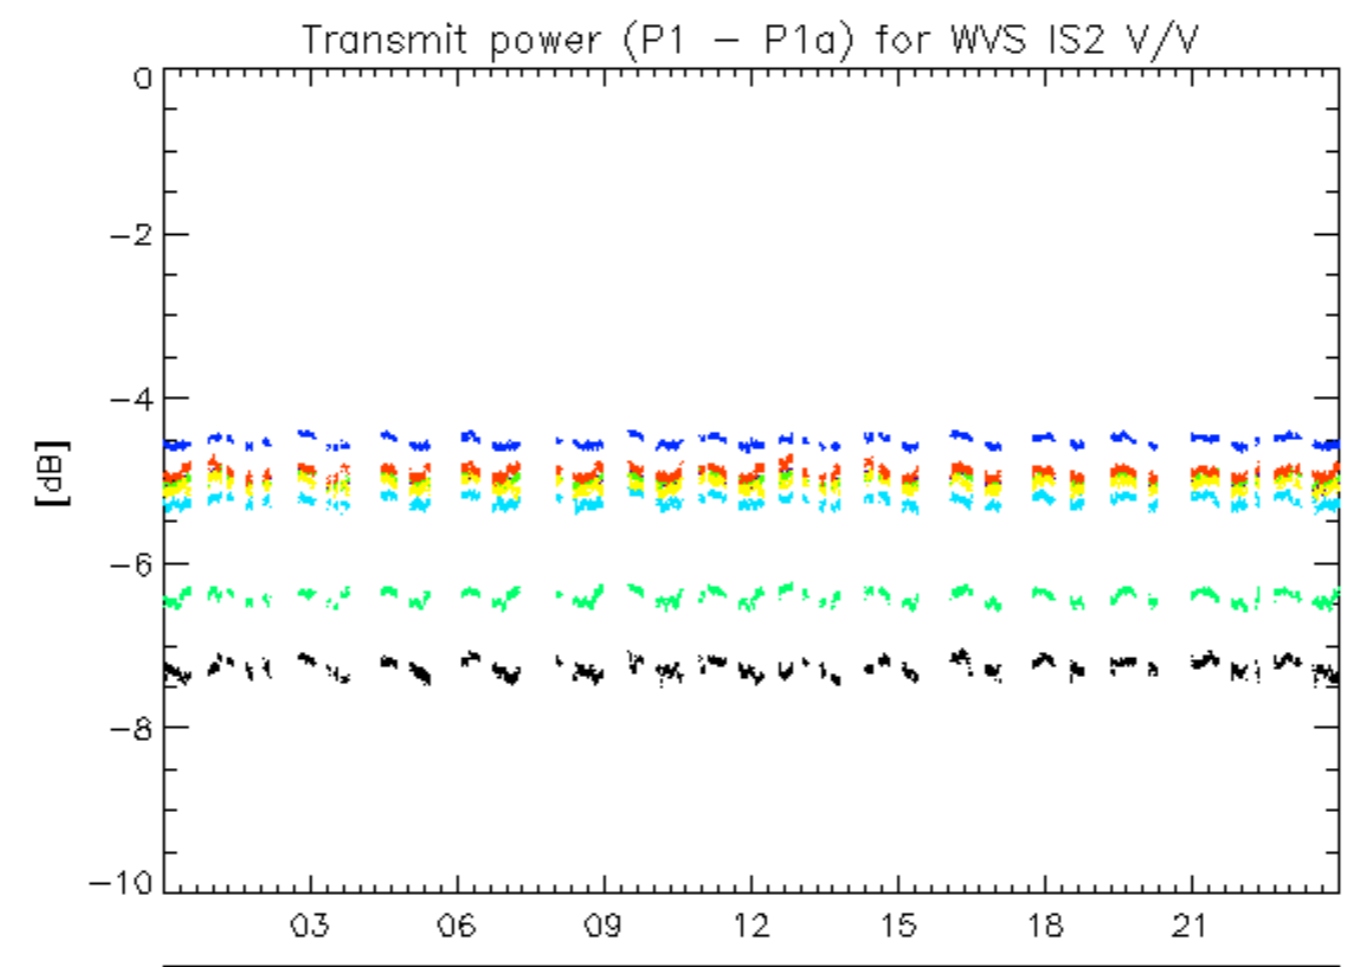


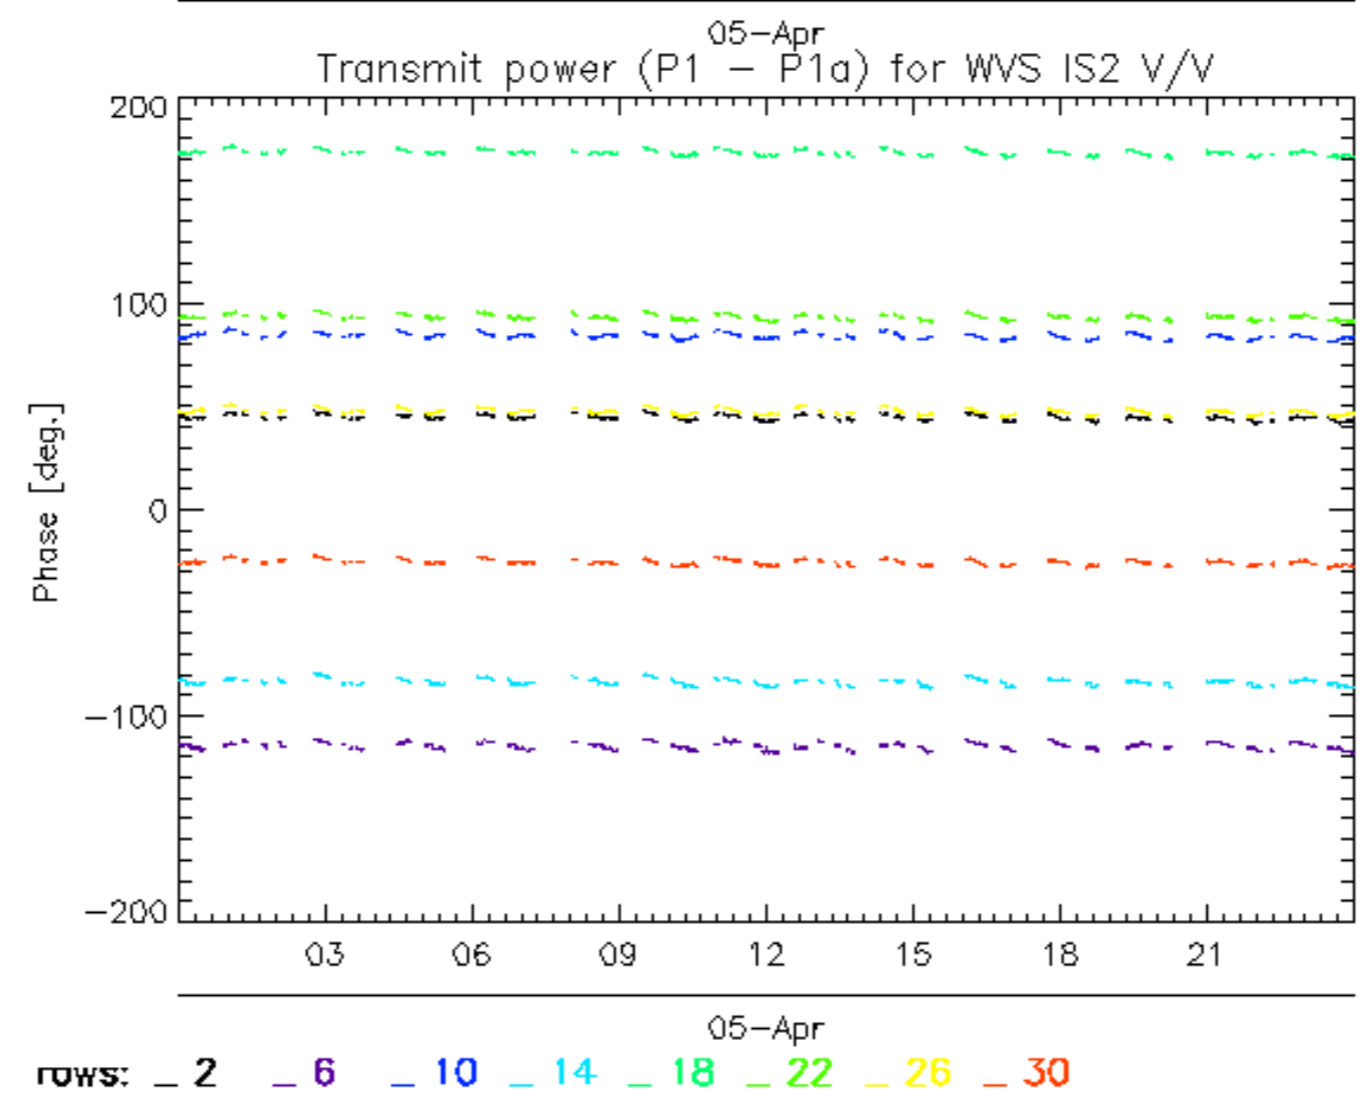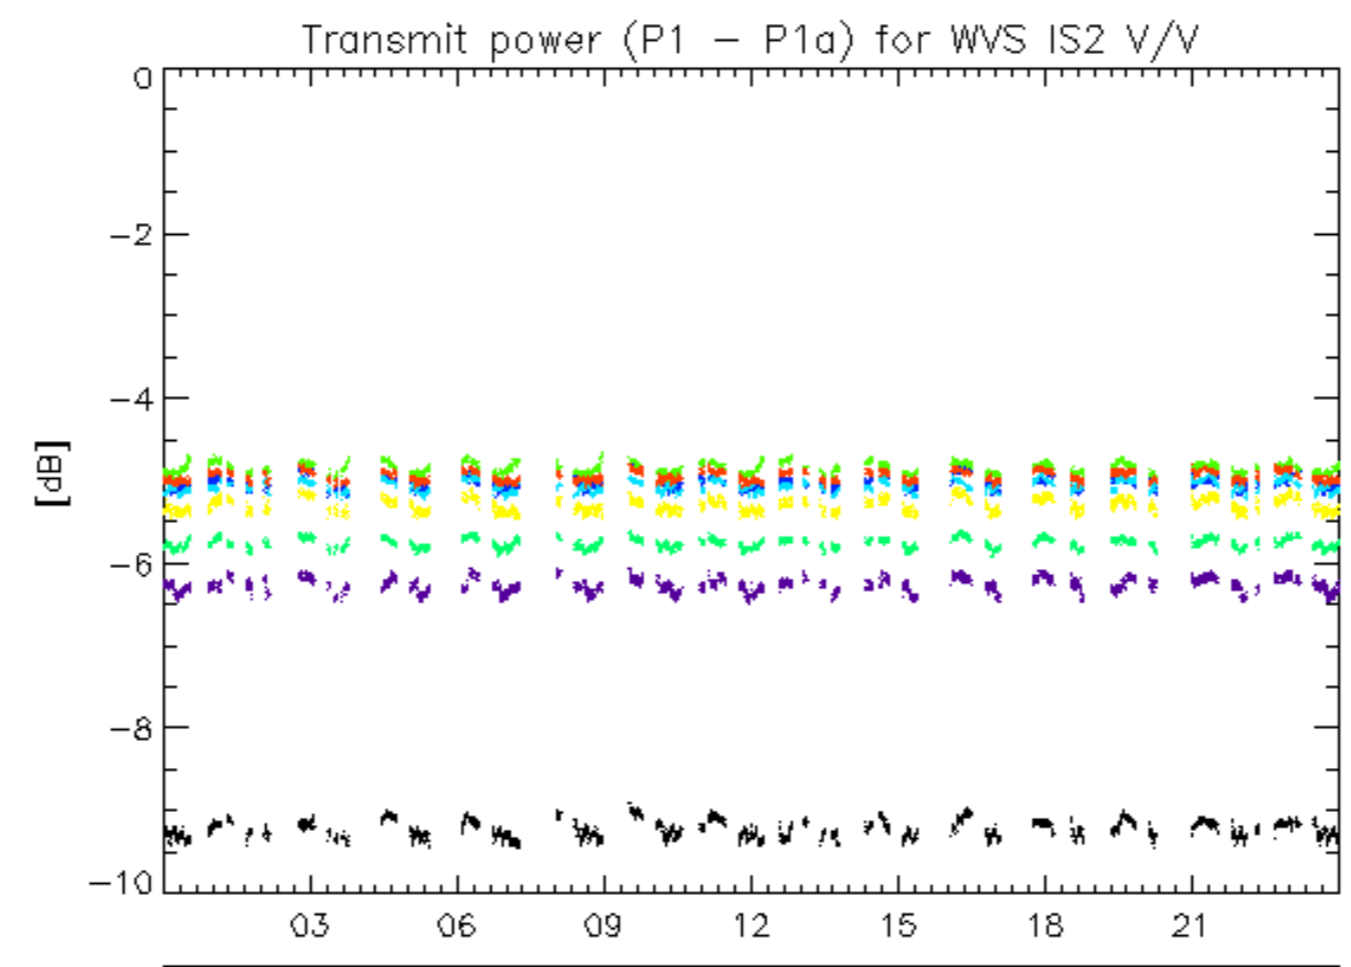


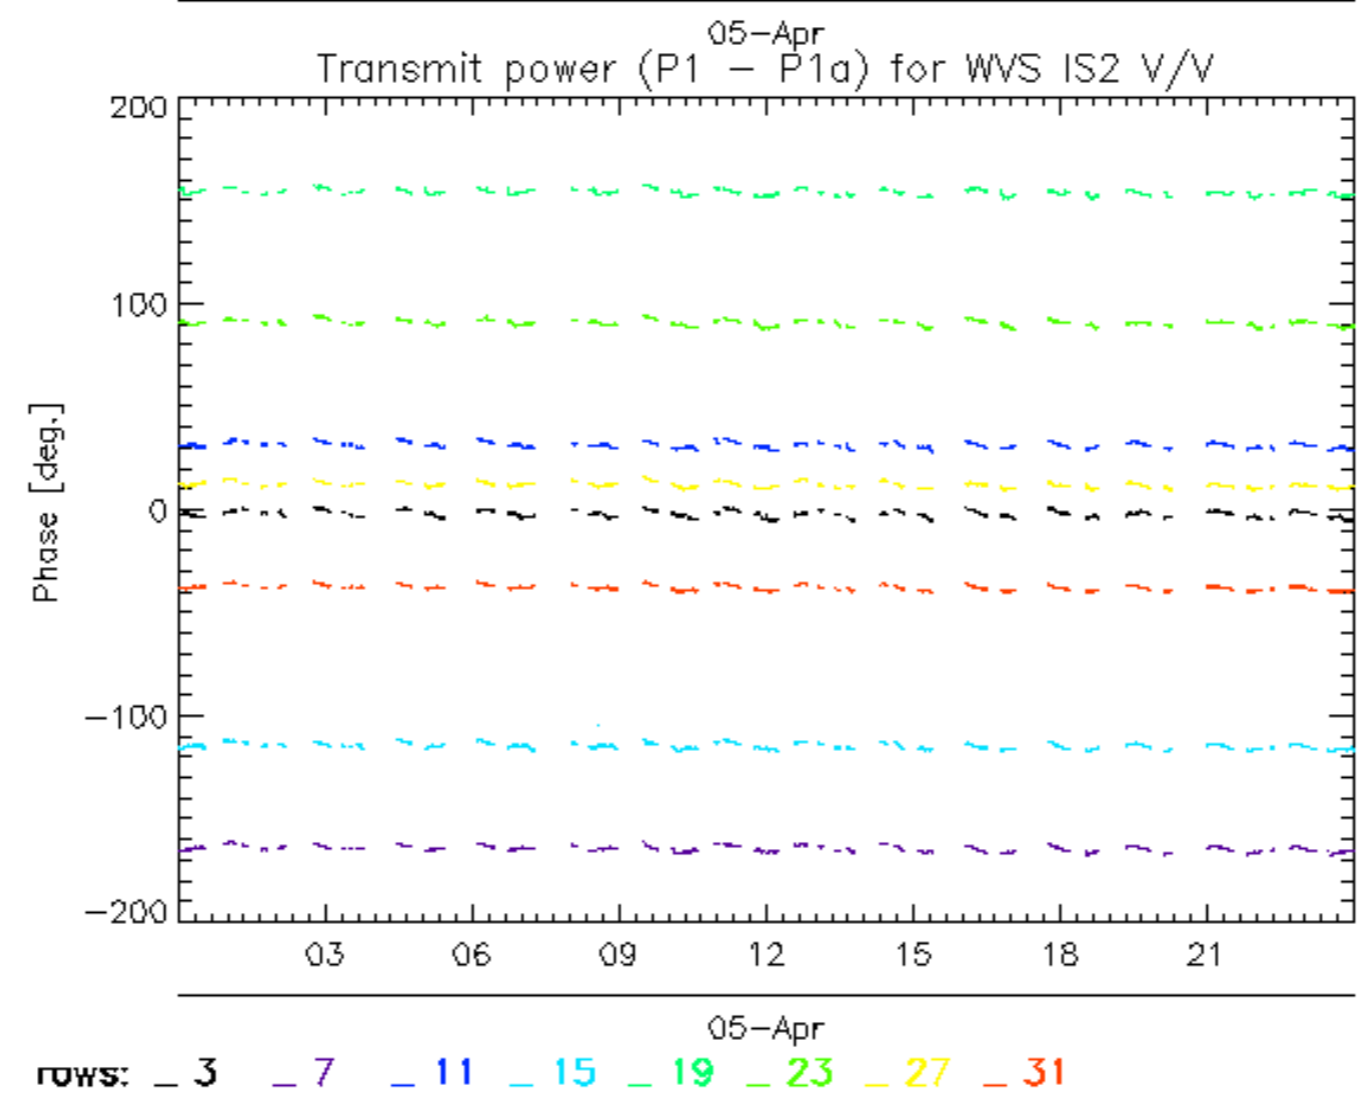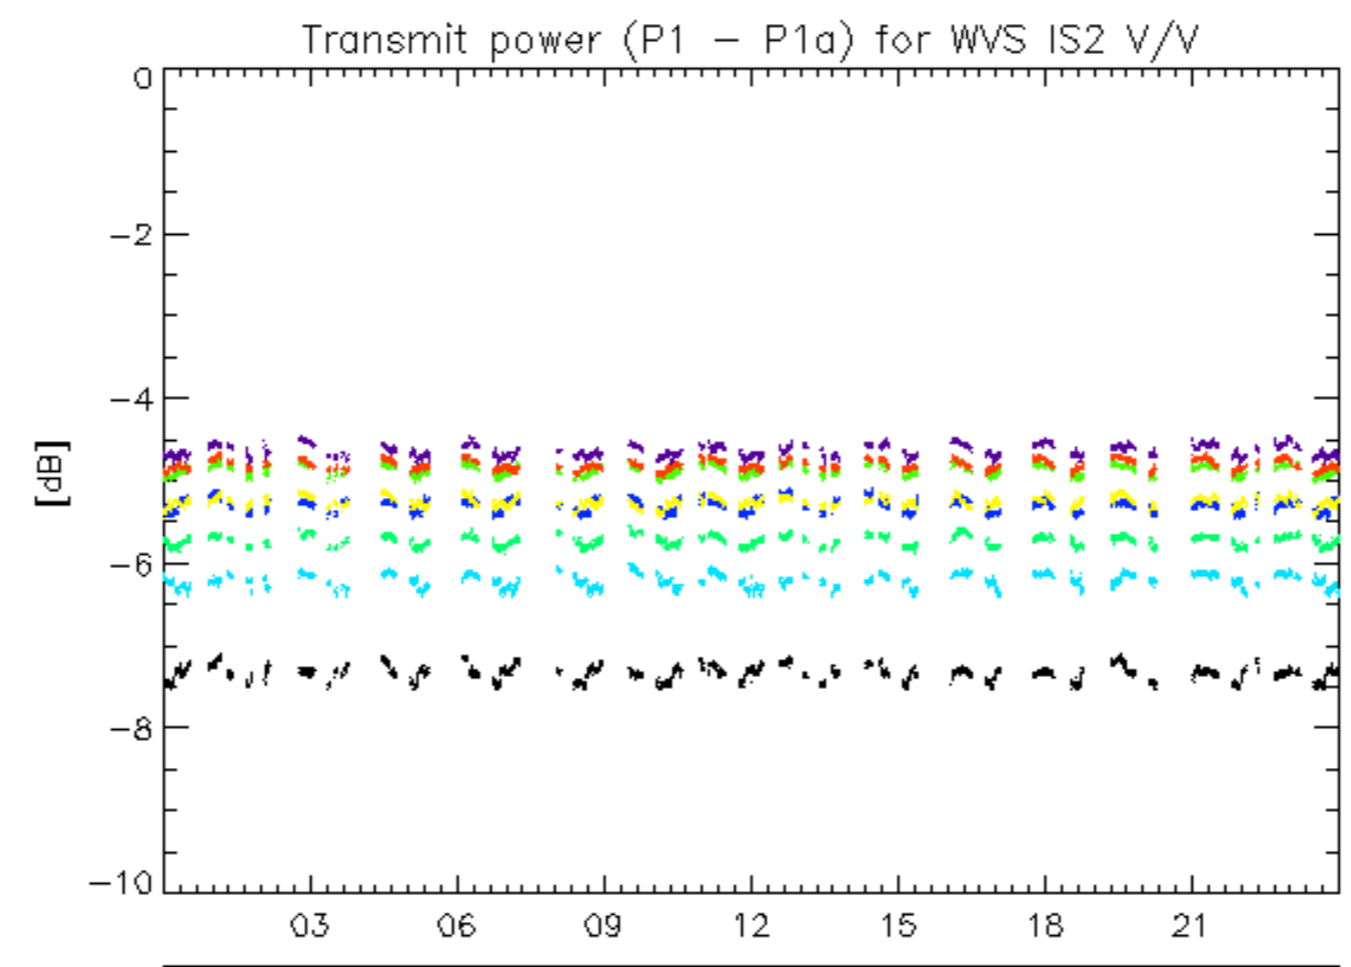

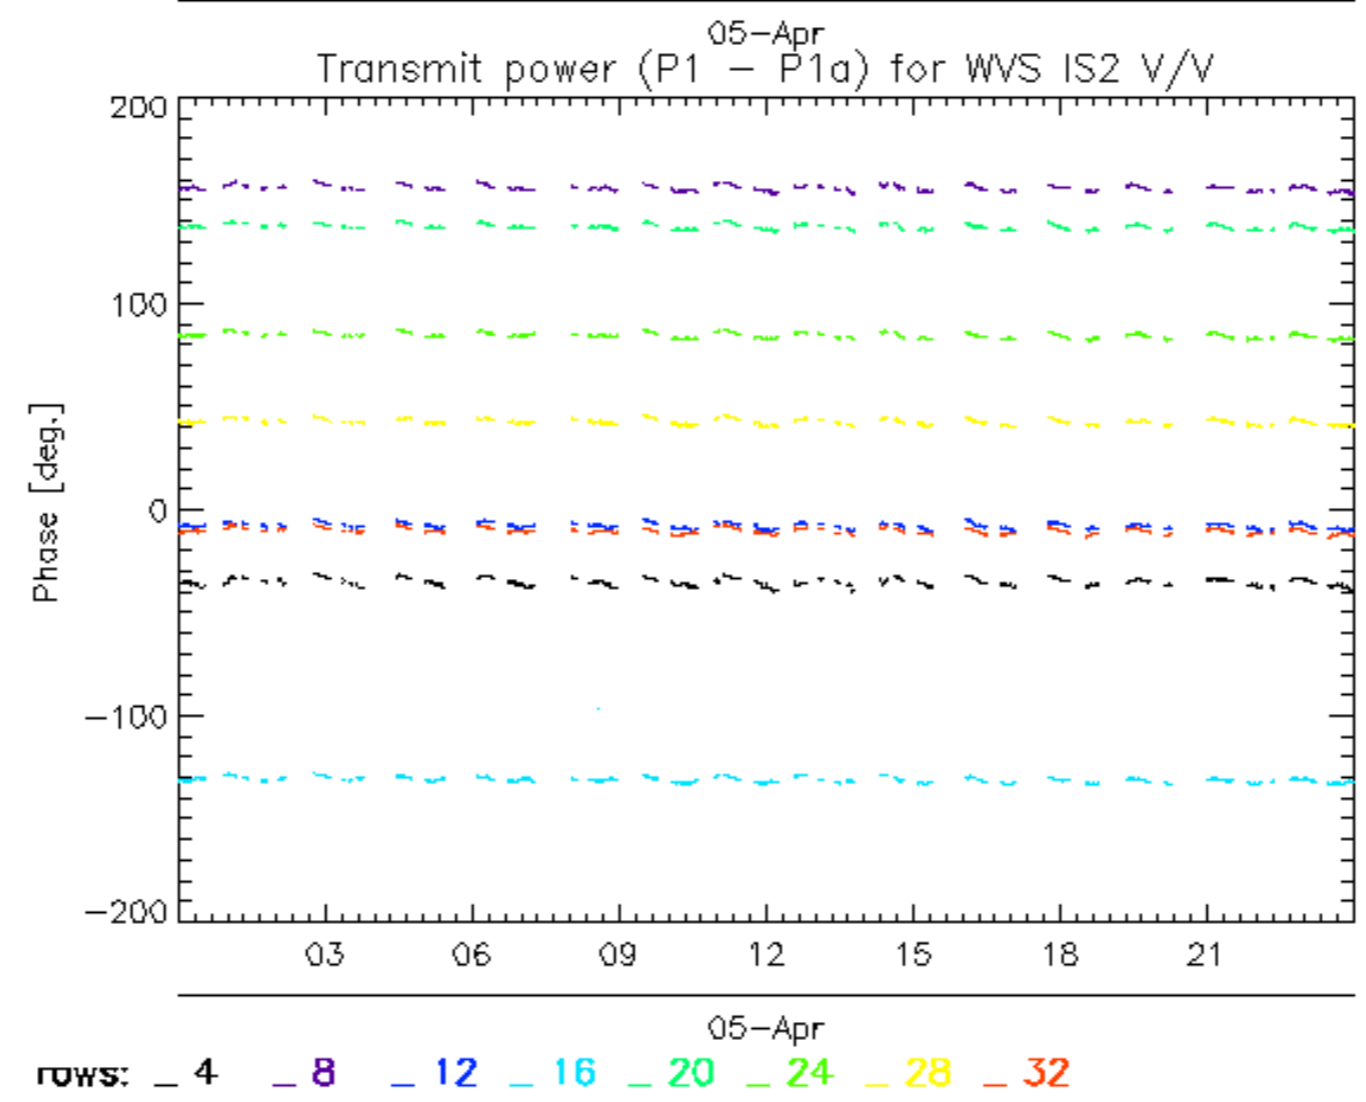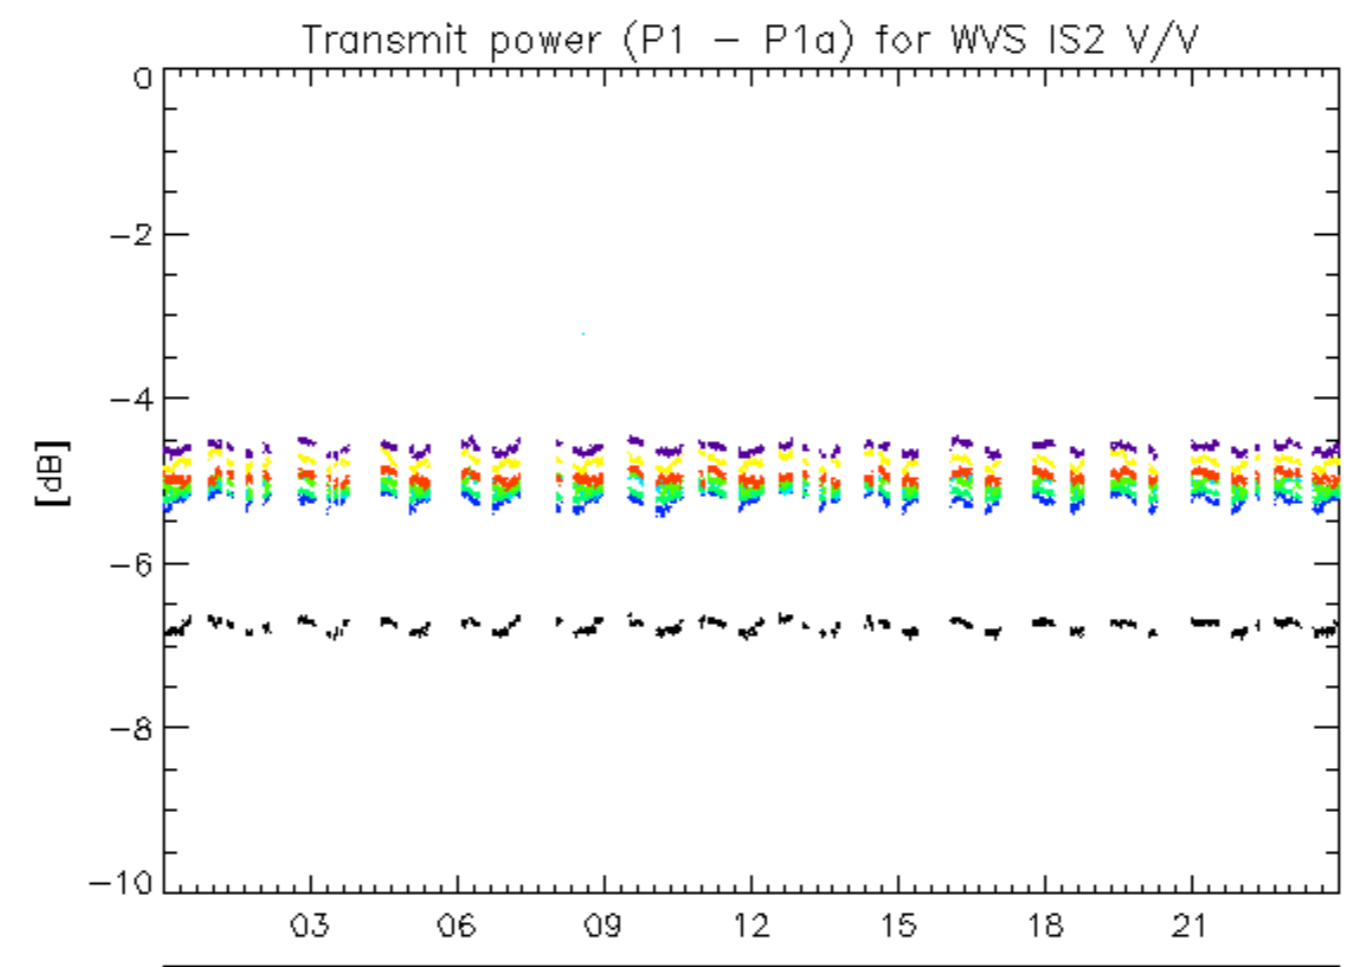



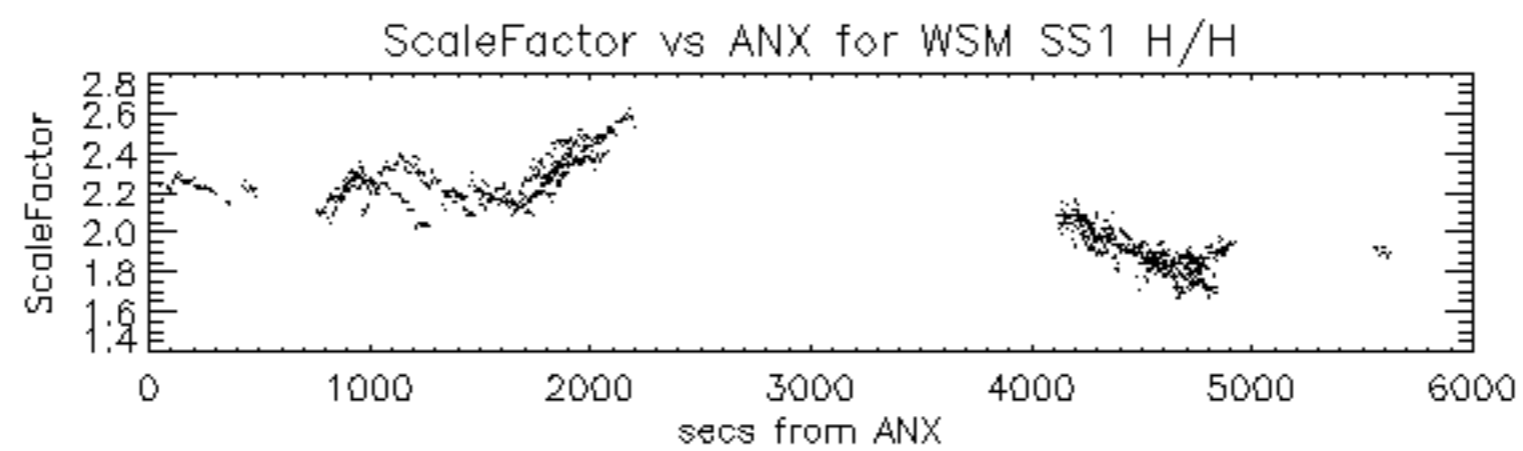

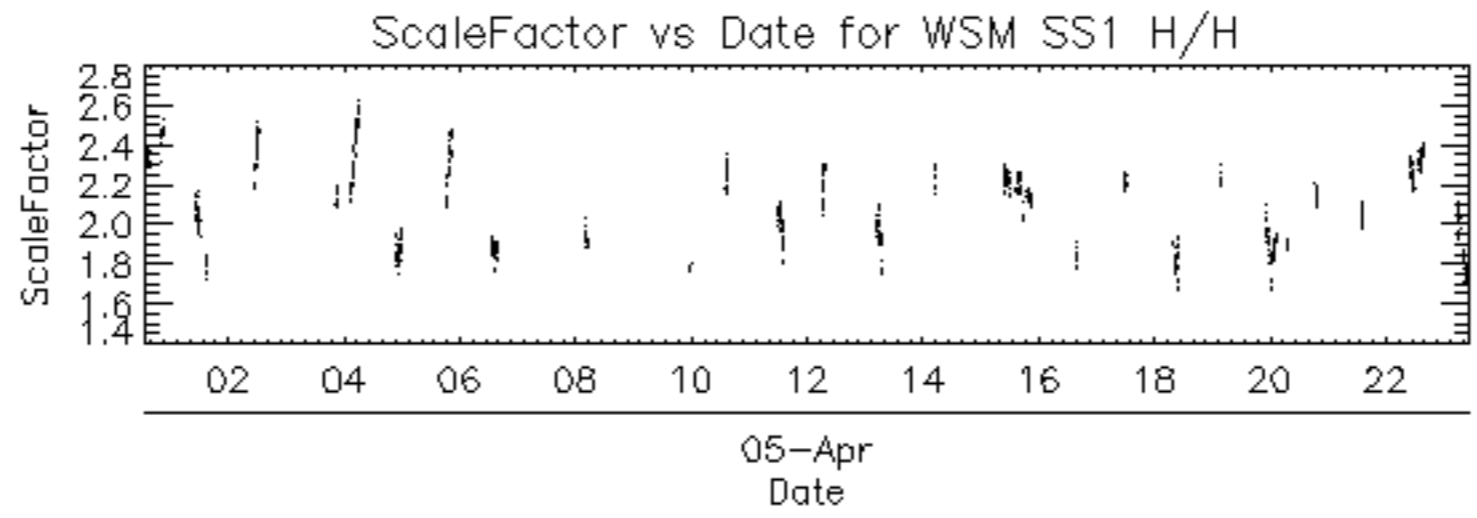

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_APM_1PNPDE20070405_021054_000000402057_00032_26639_9434.N1						IS1	H/H	57	26639	32	4.04
ASA_APM_1PNPDE20070405_053251_000000422057_00034_26641_9744.N1						IS2	H/H	57	26641	34	4.04
ASA_APM_1PNPDE20070405_061318_000000732057_00034_26641_9956.N1						IS6	H/H	57	26641	34	4.04
ASA_APM_1PNPDE20070405_061607_000000602057_00034_26641_9948.N1						IS4	H/H	57	26641	34	4.04
ASA_APM_1PNPDE20070405_074544_000001992057_00035_26642_9928.N1						IS4	H/V	57	26642	35	4.04
ASA_APM_1PNPDK20070405_091157_000000722057_00036_26643_7230.N1						IS3	H/H	57	26643	36	4.04
ASA_APM_1PNPDE20070405_091846_000000422057_00036_26643_9935.N1						IS1	H/H	57	26643	36	4.04
ASA_APM_1PNPDE20070405_115821_000001002057_00037_26644_0037.N1						IS6	H/V	57	26644	37	4.04
ASA_APM_1PNPDK20070405_134851_000000562057_00039_26646_7533.N1						IS2	H/H	57	26646	39	4.04
ASA_APM_1PNPDE20070405_201805_000001342057_00042_26649_0225.N1						IS3	H/V	57	26649	42	4.04
ASA_APM_1PNPDE20070405_220747_000000422057_00044_26651_0456.N1						IS2	H/H	57	26651	44	4.04

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_GM1_1PNPDE20070404_235750_000001502057_00030_26637_9144.N1						SS1	H/H	57	26637	30	4.04
ASA_GM1_1PNPDE20070405_004026_000006102057_00031_26638_9190.N1						SS1	H/H	57	26638	31	4.04
ASA_GM1_1PNPDE20070405_005307_000001022057_00031_26638_9195.N1						SS1	H/H	57	26638	31	4.04
ASA_GM1_1PNPDE20070405_011153_000002232057_00031_26638_9197.N1						SS1	H/H	57	26638	31	4.04
ASA_GM1_1PNPDE20070405_011632_000000902057_00031_26638_9202.N1						SS1	H/H	57	26638	31	4.04
ASA_GM1_1PNPDE20070405_013052_000002892057_00031_26638_9207.N1						SS1	H/H	57	26638	31	4.04
ASA_GM1_1PNPDE20070405_013727_000002112057_00031_26638_9209.N1						SS1	H/H	57	26638	31	4.04
ASA_GM1_1PNPDE20070405_014933_000002232057_00031_26638_9347.N1						SS1	H/H	57	26638	31	4.04
ASA_GM1_1PNPDE20070405_021202_000009002057_00032_26639_9349.N1						SS1	H/H	57	26639	32	4.04
ASA_GM1_1PNPDE20070405_023208_000004532057_00032_26639_9358.N1						SS1	H/H	57	26639	32	4.04
ASA_GM1_1PNPDE20070405_024047_000000782057_00032_26639_9372.N1						SS1	H/H	57	26639	32	4.04
ASA_GM1_1PNPDE20070405_030537_000009242057_00032_26639_9506.N1						SS1	H/H	57	26639	32	4.04
ASA_GM1_1PNPDE20070405_032431_000003382057_00032_26639_9501.N1						SS1	H/H	57	26639	32	4.04
ASA_GM1_1PNPDE20070405_033417_000002652057_00032_26639_9499.N1						SS1	H/H	57	26639	32	4.04
ASA_GM1_1PNPDE20070405_034121_000000962057_00033_26640_9513.N1						SS1	H/H	57	26640	33	4.04
ASA_GM1_1PNPDE20070405_034657_000002532057_00033_26640_9508.N1						SS1	H/H	57	26640	33	4.04
ASA_GM1_1PNPDE20070405_035252_000008092057_00033_26640_9527.N1						SS1	H/H	57	26640	33	4.04
ASA_GM1_1PNPDE20070405_041551_000004712057_00033_26640_9532.N1						SS1	H/H	57	26640	33	4.04
ASA_GM1_1PNPDE20070405_042527_000000662057_00033_26640_9543.N1						SS1	H/H	57	26640	33	4.04
ASA_GM1_1PNPDE20070405_045131_000001382057_00033_26640_9739.N1						SS1	H/H	57	26640	33	4.04
ASA_GM1_1PNPDE20070405_050005_000001262057_00033_26640_9752.N1						SS1	H/H	57	26640	33	4.04
ASA_GM1_1PNPDE20070405_052633_000002772057_00034_26641_9762.N1						SS1	H/H	57	26641	34	4.04
ASA_GM1_1PNPDE20070405_053756_000005012057_00034_26641_9760.N1						SS1	H/H	57	26641	34	4.04
ASA_GM1_1PNPDE20070405_055234_000007372057_00034_26641_9784.N1						SS1	H/H	57	26641	34	4.04
ASA_GM1_1PNPDK20070405_062805_000002412057_00034_26641_7014.N1						SS1	H/H	57	26641	34	4.04
ASA_GM1_1PNPDK20070405_063937_000001872057_00034_26641_7019.N1						SS1	H/H	57	26641	34	4.04
ASA_GM1_1PNPDK20070405_071842_000005862057_00035_26642_7033.N1						SS1	H/H	57	26642	35	4.04
ASA_GM1_1PNPDK20070405_072747_000005862057_00035_26642_7095.N1						SS1	H/H	57	26642	35	4.04
ASA_GM1_1PNPDK20070405_075457_000001692057_00035_26642_7097.N1						SS1	H/H	57	26642	35	4.04
ASA_GM1_1PNPDK20070405_075841_000001322057_00035_26642_7099.N1						SS1	H/H	57	26642	35	4.04
ASA_GM1_1PNPDK20070405_080725_000001572057_00035_26642_7101.N1						SS1	H/H	57	26642	35	4.04
ASA_GM1_1PNPDK20070405_081244_000006342057_00035_26642_7111.N1						SS1	H/H	57	26642	35	4.04
ASA_GM1_1PNPDK20070405_085835_000006642057_00036_26643_7178.N1						SS1	H/H	57	26643	36	4.04
ASA_GM1_1PNPDK20070405_094801_000002832057_00036_26643_7243.N1						SS1	H/H	57	26643	36	4.04
ASA_GM1_1PNPDK20070405_095958_000002412057_00036_26643_7248.N1						SS1	H/H	57	26643	36	4.04
ASA_GM1_1PNPDK20070405_103826_000006882057_00037_26644_7307.N1						SS1	H/H	57	26644	37	4.04
ASA_GM1_1PNPDK20070405_104916_000002472057_00037_26644_7351.N1						SS1	H/H	57	26644	37	4.04
ASA_GM1_1PNPDK20070405_113623_000004892057_00037_26644_7361.N1						SS1	H/H	57	26644	37	4.04
ASA_GM1_1PNPDK20070405_121832_000005312057_00038_26645_7387.N1						SS1	H/H	57	26645	38	4.04
ASA_GM1_1PNPDK20070405_125354_000000782057_00038_26645_7434.N1						SS1	H/H	57	26645	38	4.04
ASA_GM1_1PNPDK20070405_125806_000001992057_00038_26645_7436.N1						SS1	H/H	57	26645	38	4.04
ASA_GM1_1PNPDK20070405_130136_000001082057_00038_26645_7438.N1						SS1	H/H	57	26645	38	4.04
ASA_GM1_1PNPDK20070405_130913_000001632057_00038_26645_7443.N1						SS1	H/H	57	26645	38	4.04
ASA_GM1_1PNPDK20070405_131838_000003922057_00038_26645_7448.N1						SS1	H/H	57	26645	38	4.04
ASA_GM1_1PNPDK20070405_133106_000004532057_00038_26645_7450.N1						SS1	H/H	57	26645	38	4.04
ASA_GM1_1PNPDK20070405_135247_000008942057_00039_26646_7463.N1						SS1	H/H	57	26646	39	4.04
ASA_GM1_1PNPDK20070405_140658_000003082057_00039_26646_7573.N1						SS1	H/H	57	26646	39	4.04
ASA_GM1_1PNPDK20070405_141433_000001872057_00039_26646_7575.N1						SS1	H/H	57	26646	39	4.04
ASA_GM1_1PNPDK20070405_142935_000004592057_00039_26646_7580.N1						SS1	H/H	57	26646	39	4.04
ASA_GM1_1PNPDK20070405_154429_000001932057_00040_26647_7715.N1						SS1	H/H	57	26647	40	4.04
ASA_GM1_1PNPDK20070405_155219_000004162057_00040_26647_7717.N1						SS1	H/H	57	26647	40	4.04
ASA_GM1_1PNPDK20070405_160202_000001932057_00040_26647_7719.N1						SS1	H/H	57	26647	40	4.04
ASA_GM1_1PNPDK20070405_163025_000004772057_00040_26647_7721.N1						SS1	H/H	57	26647	40	4.04
ASA_GM1_1PNPDK20070405_164028_000003562057_00040_26647_7733.N1						SS1	H/H	57	26647	40	4.04
ASA_GM1_1PNPDK20070405_170851_000001262057_00041_26648_7731.N1						SS1	H/H	57	26648	41	4.04
ASA_GM1_1PNPDK20070405_171544_000004162057_00041_26648_7738.N1						SS1	H/H	57	26648	41	4.04
ASA_GM1_1PNPDK20070405_172135_000003982057_00041_26648_7828.N1						SS1	H/H	57	26648	41	4.04
ASA_GM1_1PNPDK20070405_173108_000000722057_00041_26648_7830.N1						SS1	H/H	57	26648	41	4.04
ASA_GM1_1PNPDK20070405_173839_000002472057_00041_26648_7832.N1						SS1	H/H	57	26648	41	4.04
ASA_GM1_1PNPDK20070405_181101_000005312057_00041_26648_7837.N1						SS1	H/H	57	26648	41	4.04
ASA_GM1_1PNPDK20070405_182530_000000902057_00041_26648_7835.N1						SS1	H/H	57	26648	41	4.04
ASA_GM1_1PNPDK20070405_184804_000003622057_00042_26649_7842.N1						SS1	H/H	57	26649	42	4.04
ASA_GM1_1PNPDK20070405_185712_000002772057_00042_26649_7847.N1						SS1	H/H	57	26649	42	4.04
ASA_GM1_1PNPDK20070405_190047_000003862057_00042_26649_7940.N1						SS1	H/H	57	26649	42	4.04
ASA_GM1_1PNPDK20070405_190958_000004712057_00042_26649_7947.N1						SS1	H/H	57	26649	42	4.04
ASA_GM1_1PNPDK20070405_195137_000002172057_00042_26649_7949.N1						SS1	H/H	57	26649	42	4.04
ASA_GM1_1PNPDK20070405_200626_000000662057_00042_26649_7951.N1						SS1	H/H	57	26649	42	4.04



ASA_GM1_1PNPDK20070405_202047_000007732057_00042_26649_7970.N1	SS1	H/H	57	26649	42	4.04
ASA_GM1_1PNPDE20070405_204400_000001572057_00043_26650_0223.N1	SS1	H/H	57	26650	43	4.04
ASA_GM1_1PNPDE20070405_204946_000002892057_00043_26650_0231.N1	SS1	H/H	57	26650	43	4.04
ASA_GM1_1PNPDE20070405_213213_000001382057_00043_26650_0227.N1	SS1	H/H	57	26650	43	4.04
ASA_GM1_1PNPDE20070405_213619_000001382057_00043_26650_0229.N1	SS1	H/H	57	26650	43	4.04
ASA_GM1_1PNPDE20070405_214604_000001262057_00043_26650_0233.N1	SS1	H/H	57	26650	43	4.04
ASA_GM1_1PNPDE20070405_220854_000003742057_00044_26651_0362.N1	SS1	H/H	57	26651	44	4.04
ASA_GM1_1PNPDE20070405_222941_000002472057_00044_26651_0364.N1	SS1	H/H	57	26651	44	4.04
ASA_GM1_1PNPDE20070405_230352_000001202057_00044_26651_0366.N1	SS1	H/H	57	26651	44	4.04
ASA_GM1_1PNPDE20070405_231249_000000722057_00044_26651_0371.N1	SS1	H/H	57	26651	44	4.04
ASA_GM1_1PNPDE20070405_231645_000001752057_00044_26651_0373.N1	SS1	H/H	57	26651	44	4.04
ASA_GM1_1PNPDE20070405_232623_000001442057_00044_26651_0386.N1	SS1	H/H	57	26651	44	4.04

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20070405_003838_000000902057_00031_26638_9360.N1						IS2	H/H	57	26638	31	4.04
ASA_IMM_1PNPDE20070405_011540_000000352057_00031_26638_9301.N1						IS6	V/V	57	26638	31	4.04
ASA_IMM_1PNPDE20070405_074211_000001882057_00035_26642_9916.N1						IS2	V/V	57	26642	35	4.04
ASA_IMM_1PNPDE20070405_074943_000002972057_00035_26642_9930.N1						IS2	V/V	57	26642	35	4.04
ASA_IMM_1PNPDE20070405_075748_000000342057_00035_26642_9898.N1						IS2	V/V	57	26642	35	4.04
ASA_IMM_1PNPDK20070405_105430_000001612057_00037_26644_7332.N1						IS2	V/V	57	26644	37	4.04
ASA_IMM_1PNPDK20070405_122817_000000362057_00038_26645_7356.N1						IS3	H/H	57	26645	38	4.04
ASA_IMM_1PNPDK20070405_123011_000002182057_00038_26645_7417.N1						IS2	H/H	57	26645	38	4.04
ASA_IMM_1PNPDK20070405_135039_000000362057_00039_26646_7531.N1						IS2	V/V	57	26646	39	4.04
ASA_IMM_1PNPDK20070405_135140_000000502057_00039_26646_7535.N1						IS3	V/V	57	26646	39	4.04
ASA_IMM_1PNPDE20070405_153216_000000662057_00040_26647_0098.N1						IS2	V/V	57	26647	40	4.04
ASA_IMM_1PNPDE20070405_171057_000002692057_00041_26648_0128.N1						IS2	V/V	57	26648	41	4.04
ASA_IMM_1PNPDK20070405_190714_000000362057_00042_26649_7854.N1						IS3	H/H	57	26649	42	4.04
ASA_IMM_1PNPDK20070405_203635_000001282057_00043_26650_8014.N1						IS2	V/V	57	26650	43	4.04
ASA_IMM_1PNPDK20070405_222252_000000562057_00044_26651_8048.N1						IS2	V/V	57	26651	44	4.04

Filename	Pol	Timestamp	count(Module)
ASA_MS__0PNPDK20070405_062641_000000162057_00034_26641_0258.N1	H	2007-04-05 06:26:41	320



Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WSM_1PNPDE20070405_003333_000002912057_00031_26638_9370.N1						SS1	H/H	57	26638	31	4.04
ASA_WSM_1PNPDE20070405_005052_000000912057_00031_26638_9430.N1						SS1	H/H	57	26638	31	4.04
ASA_WSM_1PNPDE20070405_012605_000002752057_00031_26638_9353.N1						SS1	H/H	57	26638	31	4.04
ASA_WSM_1PNPDE20070405_013549_000000862057_00031_26638_9342.N1						SS1	H/H	57	26638	31	4.04
ASA_WSM_1PNPDE20070405_015352_000000922057_00031_26638_9428.N1						SS1	V/V	57	26638	31	4.04
ASA_WSM_1PNPDE20070405_015752_000003292057_00031_26638_9551.N1						SS1	V/V	57	26638	31	4.04
ASA_WSM_1PNPDE20070405_022718_000002672057_00032_26639_9481.N1						SS1	H/H	57	26639	32	4.04
ASA_WSM_1PNPDE20070405_024214_000001412057_00032_26639_9477.N1						SS1	V/V	57	26639	32	4.04
ASA_WSM_1PNPDE20070405_035118_000000862057_00033_26640_9601.N1						SS1	H/H	57	26640	33	4.04
ASA_WSM_1PNPDE20070405_040629_000004292057_00033_26640_9750.N1						SS1	H/H	57	26640	33	4.04
ASA_WSM_1PNPDE20070405_040629_000005452057_00033_26640_9873.N1						SS1	H/H	57	26640	33	4.04
ASA_WSM_1PNPDE20070405_041433_000000612057_00033_26640_9721.N1						SS1	H/H	57	26640	33	4.04
ASA_WSM_1PNPDE20070405_042353_000000862057_00033_26640_9688.N1						SS1	V/V	57	26640	33	4.04
ASA_WSM_1PNPDE20070405_045357_000003612057_00033_26640_9885.N1						SS1	H/H	57	26640	33	4.04
ASA_WSM_1PNPDE20070405_053122_000000862057_00034_26641_9865.N1						SS1	V/V	57	26641	34	4.04
ASA_WSM_1PNPDE20070405_053422_000002022057_00034_26641_9875.N1						SS1	V/V	57	26641	34	4.04
ASA_WSM_1PNPDK20070405_054629_000003532057_00034_26641_7009.N1						SS1	H/H	57	26641	34	4.04
ASA_WSM_1PNPDK20070405_063218_000004282057_00034_26641_7088.N1						SS1	H/H	57	26641	34	4.04
ASA_WSM_1PNPDK20070405_071608_000001412057_00035_26642_7083.N1						SS1	V/V	57	26642	35	4.04
ASA_WSM_1PNPDK20070405_081010_000001412057_00035_26642_7226.N1						SS1	H/H	57	26642	35	4.04
ASA_WSM_1PNPDK20070405_090952_000000852057_00036_26643_7228.N1						SS1	V/V	57	26643	36	4.04
ASA_WSM_1PNPDE20070405_091731_000000672057_00036_26643_9932.N1						SS1	V/V	57	26643	36	4.04
ASA_WSM_1PNPDE20070405_092523_000000672057_00036_26643_9938.N1						SS1	V/V	57	26643	36	4.04
ASA_WSM_1PNPDE20070405_092523_000002982057_00036_26643_9958.N1						SS1	V/V	57	26643	36	4.04
ASA_WSM_1PNPDE20070405_092731_000001702057_00036_26643_9954.N1						SS1	V/V	57	26643	36	4.04
ASA_WSM_1PNPDE20070405_095849_000000612057_00036_26643_9960.N1						SS1	H/H	57	26643	36	4.04
ASA_WSM_1PNPDE20070405_103517_000001712057_00037_26644_9985.N1						SS1	H/H	57	26644	37	4.04
ASA_WSM_1PNPDE20070405_110357_000002322057_00037_26644_0008.N1						SS1	V/V	57	26644	37	4.04
ASA_WSM_1PNPDE20070405_112949_000003852057_00037_26644_0006.N1						SS1	H/H	57	26644	37	4.04
ASA_WSM_1PNPDE20070405_121515_000001772057_00038_26645_0055.N1						SS1	H/H	57	26645	38	4.04
ASA_WSM_1PNPDE20070405_125522_000001532057_00038_26645_0039.N1						SS1	V/V	57	26645	38	4.04
ASA_WSM_1PNPDK20070405_131204_000003852057_00038_26645_7565.N1						SS1	H/H	57	26645	38	4.04
ASA_WSM_1PNPDK20070405_141216_000001162057_00039_26646_7563.N1						SS1	H/H	57	26646	39	4.04
ASA_WSM_1PNPDE20070405_152347_000002442057_00040_26647_0130.N1						SS1	H/H	57	26647	40	4.04
ASA_WSM_1PNPDE20070405_152852_000000182057_00040_26647_0122.N1						SS1	H/H	57	26647	40	4.04
ASA_WSM_1PNPDE20070405_152954_000000862057_00040_26647_0126.N1						SS1	H/H	57	26647	40	4.04
ASA_WSM_1PNPDE20070405_153638_000002612057_00040_26647_0068.N1						SS1	H/H	57	26647	40	4.04
ASA_WSM_1PNPDK20070405_154033_000002262057_00040_26647_7697.N1						SS1	H/H	57	26647	40	4.04
ASA_WSM_1PNPDK20070405_154750_000002442057_00040_26647_7707.N1						SS1	H/H	57	26647	40	4.04
ASA_WSM_1PNPDK20070405_154857_000001762057_00040_26647_7699.N1						SS1	H/H	57	26647	40	4.04
ASA_WSM_1PNPDE20070405_163832_000001032057_00040_26647_0110.N1						SS1	H/H	57	26647	40	4.04
ASA_WSM_1PNPDK20070405_172821_000001582057_00041_26648_7817.N1						SS1	H/H	57	26648	41	4.04
ASA_WSM_1PNPDE20070405_182000_000003062057_00041_26648_0179.N1						SS1	H/H	57	26648	41	4.04
ASA_WSM_1PNPDK20070405_190816_000000912057_00042_26649_7926.N1						SS1	H/H	57	26649	42	4.04
ASA_WSM_1PNPDE20070405_191759_000001282057_00042_26649_0215.N1						SS1	V/V	57	26649	42	4.04
ASA_WSM_1PNPDE20070405_195526_000001462057_00042_26649_0219.N1						SS1	H/H	57	26649	42	4.04
ASA_WSM_1PNPDE20070405_195854_000004282057_00042_26649_0221.N1						SS1	H/H	57	26649	42	4.04
ASA_WSM_1PNPDE20070405_201638_000000852057_00042_26649_0217.N1						SS1	H/H	57	26649	42	4.04
ASA_WSM_1PNPDK20070405_203924_000002442057_00043_26650_8046.N1						SS1	V/V	57	26650	43	4.04
ASA_WSM_1PNPDK20070405_204648_000001702057_00043_26650_8044.N1						SS1	H/H	57	26650	43	4.04
ASA_WSM_1PNPDE20070405_205447_000003042057_00043_26650_0351.N1						SS1	V/V	57	26650	43	4.04
ASA_WSM_1PNPDE20070405_213441_000000852057_00043_26650_0349.N1						SS1	H/H	57	26650	43	4.04
ASA_WSM_1PNPDK20070405_222437_000002932057_00044_26651_8060.N1						SS1	H/H	57	26651	44	4.04
ASA_WSM_1PNPDE20070405_223402_000003662057_00044_26651_0598.N1						SS1	H/H	57	26651	44	4.04
ASA_WSM_1PNPDE20070405_231412_000001292057_00044_26651_0495.N1						SS1	H/H	57	26651	44	4.04
ASA_WSM_1PNPDE20070405_231953_000003672057_00044_26651_0592.N1						SS1	H/H	57	26651	44	4.04



Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20070405_000024_000003292057_00030_26637_9147.N1						IS2	V/V	57	26637	30	4.04
ASA_WVS_1PNPDE20070405_000509_000016492057_00030_26637_9193.N1						IS2	V/V	57	26637	30	4.04
ASA_WVS_1PNPDE20070405_000024_000003292057_00030_26637_9147.N1						IS1	V/V	57	26637	30	4.04
ASA_WVS_1PNPDE20070405_005455_000009652057_00031_26638_9200.N1						IS2	V/V	57	26638	31	4.04
ASA_WVS_1PNPDE20070405_011802_000003752057_00031_26638_9205.N1						IS2	V/V	57	26638	31	4.04
ASA_WVS_1PNPDE20070405_014100_000002092057_00031_26638_9218.N1						IS2	V/V	57	26638	31	4.04
ASA_WVS_1PNPDE20070405_014330_000003152057_00031_26638_9345.N1						IS2	V/V	57	26638	31	4.04
ASA_WVS_1PNPDE20070405_014100_000002092057_00031_26638_9218.N1						IS1	V/V	57	26638	31	4.04
ASA_WVS_1PNPDE20070405_020323_000003742057_00032_26639_9356.N1						IS2	V/V	57	26639	32	4.04
ASA_WVS_1PNPDE20070405_024639_000007042057_00032_26639_9368.N1						IS2	V/V	57	26639	32	4.04
ASA_WVS_1PNPDE20070405_025809_000004052057_00032_26639_9504.N1						IS2	V/V	57	26639	32	4.04
ASA_WVS_1PNPDE20070405_032136_000001202057_00032_26639_9497.N1						IS2	V/V	57	26639	32	4.04
ASA_WVS_1PNPDE20070405_033010_000001942057_00032_26639_9494.N1						IS2	V/V	57	26639	32	4.04
ASA_WVS_1PNPDE20070405_033846_000001042057_00033_26640_9511.N1						IS2	V/V	57	26640	33	4.04
ASA_WVS_1PNPDE20070405_034301_000001792057_00033_26640_9530.N1						IS2	V/V	57	26640	33	4.04
ASA_WVS_1PNPDE20070405_042637_000008092057_00033_26640_9536.N1						IS2	V/V	57	26640	33	4.04
ASA_WVS_1PNPDE20070405_043952_000003302057_00033_26640_9742.N1						IS2	V/V	57	26640	33	4.04
ASA_WVS_1PNPDE20070405_050212_000014092057_00033_26640_9787.N1						IS2	V/V	57	26640	33	4.04
ASA_WVS_1PNPDE20070405_060451_000004642057_00034_26641_9765.N1						IS2	V/V	57	26641	34	4.04
ASA_WVS_1PNPDE20070405_061439_000000442057_00034_26641_9758.N1						IS2	V/V	57	26641	34	4.04
ASA_WVS_1PNPDE20070405_061717_000001952057_00034_26641_9755.N1						IS2	V/V	57	26641	34	4.04
ASA_WVS_1PNPDK20070405_062017_000003452057_00034_26641_7017.N1						IS2	V/V	57	26641	34	4.04
ASA_WVS_1PNPDE20070405_061717_000001952057_00034_26641_9755.N1						IS1	V/V	57	26641	34	4.04
ASA_WVS_1PNPDK20070405_064247_000019492057_00034_26641_7041.N1						IS2	V/V	57	26641	34	4.04
ASA_WVS_1PNPDK20070405_080055_000003452057_00035_26642_7109.N1						IS2	V/V	57	26642	35	4.04
ASA_WVS_1PNPDK20070405_082323_000020542057_00035_26642_7193.N1						IS2	V/V	57	26642	35	4.04
ASA_WVS_1PNPDK20070405_093024_000010042057_00036_26643_7246.N1						IS2	V/V	57	26643	36	4.04
ASA_WVS_1PNPDK20070405_100359_000018292057_00036_26643_7305.N1						IS2	V/V	57	26643	36	4.04
ASA_WVS_1PNPDK20070405_105717_000003442057_00037_26644_7346.N1						IS2	V/V	57	26644	37	4.04
ASA_WVS_1PNPDK20070405_110748_000005542057_00037_26644_7349.N1						IS2	V/V	57	26644	37	4.04
ASA_WVS_1PNPDK20070405_110748_000005542057_00037_26644_7349.N1						IS1	V/V	57	26644	37	4.04
ASA_WVS_1PNPDK20070405_111718_000006302057_00037_26644_7354.N1						IS2	V/V	57	26644	37	4.04
ASA_WVS_1PNPDK20070405_114435_000007802057_00037_26644_7359.N1						IS2	V/V	57	26644	37	4.04
ASA_WVS_1PNPDK20070405_120008_000008542057_00037_26644_7390.N1						IS2	V/V	57	26644	37	4.04
ASA_WVS_1PNPDK20070405_123355_000010042057_00038_26645_7441.N1						IS2	V/V	57	26645	38	4.04
ASA_WVS_1PNPDK20070405_130324_000002992057_00038_26645_7446.N1						IS2	V/V	57	26645	38	4.04
ASA_WVS_1PNPDK20070405_132511_000003002057_00038_26645_7453.N1						IS2	V/V	57	26645	38	4.04
ASA_WVS_1PNPDK20070405_133842_000005242057_00038_26645_7461.N1						IS2	V/V	57	26645	38	4.04
ASA_WVS_1PNPDK20070405_142017_000005092057_00039_26646_7578.N1						IS2	V/V	57	26646	39	4.04
ASA_WVS_1PNPDK20070405_143717_000007052057_00039_26646_7583.N1						IS2	V/V	57	26646	39	4.04
ASA_WVS_1PNPDK20070405_150547_000010342057_00039_26646_7590.N1						IS2	V/V	57	26646	39	4.04
ASA_WVS_1PNPDK20070405_160515_000014542057_00040_26647_7724.N1						IS2	V/V	57	26647	40	4.04
ASA_WVS_1PNPDK20070405_164624_000010492057_00040_26647_7736.N1						IS2	V/V	57	26647	40	4.04
ASA_WVS_1PNPDK20070405_174507_000014992057_00041_26648_7840.N1						IS2	V/V	57	26648	41	4.04
ASA_WVS_1PNPDK20070405_183102_000009742057_00041_26648_7845.N1						IS2	V/V	57	26648	41	4.04
ASA_WVS_1PNPDK20070405_192009_000018442057_00042_26649_7954.N1						IS2	V/V	57	26649	42	4.04
ASA_WVS_1PNPDK20070405_200736_000004952057_00042_26649_7963.N1						IS2	V/V	57	26649	42	4.04
ASA_WVS_1PNPDE20070405_205958_000018892057_00043_26650_0239.N1						IS2	V/V	57	26650	43	4.04
ASA_WVS_1PNPDE20070405_214812_000003152057_00043_26650_0236.N1						IS2	V/V	57	26650	43	4.04
ASA_WVS_1PNPDE20070405_215242_000007942057_00043_26650_0357.N1						IS2	V/V	57	26650	43	4.04
ASA_WVS_1PNPDE20070405_221745_000000442057_00044_26651_0354.N1						IS2	V/V	57	26651	44	4.04
ASA_WVS_1PNPDE20070405_222003_000001352057_00044_26651_0360.N1						IS2	V/V	57	26651	44	4.04
ASA_WVS_1PNPDE20070405_224114_000013042057_00044_26651_0369.N1						IS2	V/V	57	26651	44	4.04
ASA_WVS_1PNPDE20070405_230556_000003602057_00044_26651_0376.N1						IS2	V/V	57	26651	44	4.04
ASA_WVS_1PNPDE20070405_232847_000003152057_00044_26651_0379.N1						IS2	V/V	57	26651	44	4.04
ASA_WVS_1PNPDE20070405_233318_000017242057_00044_26651_0498.N1						IS2	V/V	57	26651	44	4.04

