

Analysis from 05-OCT-2008 00:00:00 to 05-OCT-2008 23:59:59. Page generated on 06-OCT-2008 08:04:32.
View log file: ASAR_Daily_Report_20081006_0730.log. For any anomalies please contact mtranfaglia@serco.it, gscarpino@serco.it, Emma.Griffiths@vega.co.uk.

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

SUMMARY

1. DATA SUMMARY
 - 1.1 Summary tables
 - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
 - 2.1 IECF operational ADFs list
 - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
 - 3.1 V/V polarisation
 - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
 - 4.1 Analysis for WVS IS2 V/V
 - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
 - 4.1.2 All Rows Analysis for WVS IS2 V/V
 - 4.2 Analysis for GM1 SS3 H/H
 - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
 - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
 - 5.1 Analysis for WVS IS2 V/V
 - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
 - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
 - 5.2 Analysis for GM1 SS1 H/H
 - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
 - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
 - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
 - 6.1 Analysis for WSM SS1 H/H
 - 6.1.1 ScaleFactor
 - 6.2 Analysis for WSM SS1 V/V
 - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
 - 7.1 Analysis for WVS
 - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
 - 8.1 Number of Missing Lines
 - 8.2 Number of Gaps

1 - DATA SUMMARY

1.1 - Summary tables

[[BACK TO MENU](#)]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	1	PDE	WS	H/H	46	PDE	IS2	H/V	1	PDE	IS2	H/H	12	PDE	WS	H/H	11	PDE	2008-10-05 05:32:03	V	320
PDE	IS2	V/V	31	PDK	WS	H/H	31	PDE	IS6	H/H	1	PDE	IS2	V/V	4	PDE	WS	V/V	5				
PDK	IS2	V/V	22									PDE	IS4	H/H	3								
												PDE	IS5	V/V	2								
												PDE	IS6	V/V	1								
												PDE	IS7	V/V	2								

1.2 - Lists of products used

[BACK TO MENU]

[TXT] [XLS] List_WVS_products_used
 [TXT] [XLS] List_GM1_products_used
 [TXT] [XLS] List_APM_products_used
 [TXT] [XLS] List_IMM_products_used
 [TXT] [XLS] List_WSM_products_used
 [TXT] [XLS] List_MS_products_used

2 - AUXILIARY FILES ANALYSIS

2.1 - IECF operational ADFs list

[BACK TO MENU]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20080710_132557_20070204_165113_20081231_000000
ASA_INS_AXVIEC20071218_083603_20070307_060000_20081231_000000
ASA_XCH_AXVIEC20051219_162547_20020301_000000_20081231_000000
ASA_XCA_AXVIEC20080710_133546_20070204_165113_20081231_000000

2.2 - Products with wrong ADFs

[BACK TO MENU]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0

[TXT] [XLS] Check_ADFs_WVS
 [TXT] [XLS] Check_ADFs_GM1
 [TXT] [XLS] Check_ADFs_APM
 [TXT] [XLS] Check_ADFs_IMM
 [TXT] [XLS] Check_ADFs_WSM

3 - MODULE STEPPING PRODUCTS ANALYSIS

SECOND FIXED REFERENCE

After antenna maintenance (2005-09-22/23)

Reference: 2005-09-23 05:55:14 V RxGain
 Test : 2008-10-05 05:32:03 V



PREVIOUS PRODUCT REFERENCE

Previous product in the same polarisation

Reference: 2008-10-03 06:35:17 V RxGain
 Test : 2008-10-05 05:32:03 V



Reference: 2005-09-23 05:55:14 V RxPhase
 Test : 2008-10-05 05:32:03 V



Reference: 2008-10-03 06:35:17 V RxPhase
 Test : 2008-10-05 05:32:03 V





3.2 - H/H polarisation


[[BACK TO MENU](#)]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
After antenna maintenance (2005-09-22/23)	Previous product in the same polarisation

Reference: 2005-09-22 06:26:51 H RxGain
 Test : 2008-10-04 06:03:40 H




Reference: 2008-10-02 07:06:54 H RxGain
 Test : 2008-10-04 06:03:40 H




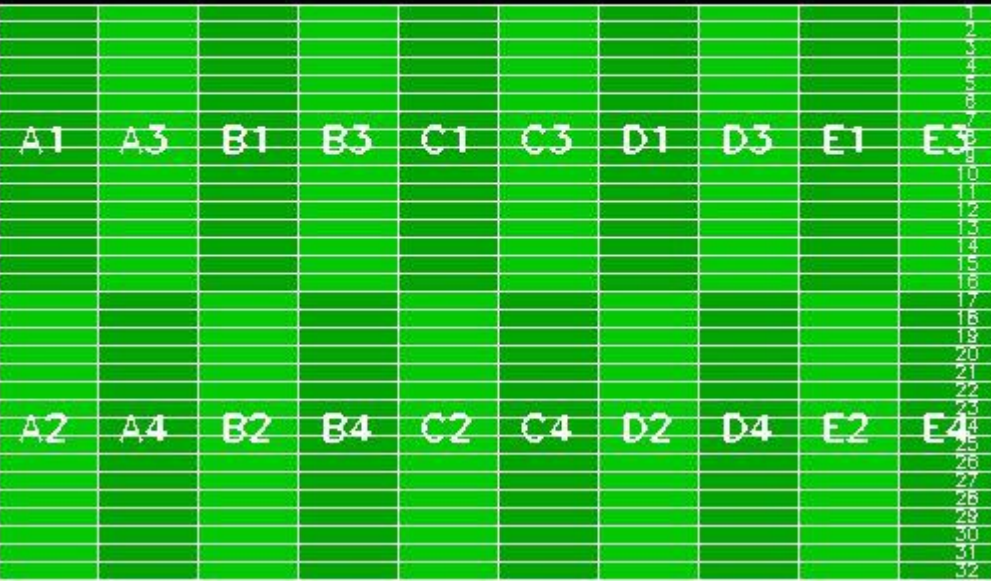


Reference: 2005-09-22 06:26:51 H RxPhase
 Test : 2008-10-04 06:03:40 H



Reference: 2008-10-02 07:06:54 H RxPhase
 Test : 2008-10-04 06:03:40 H

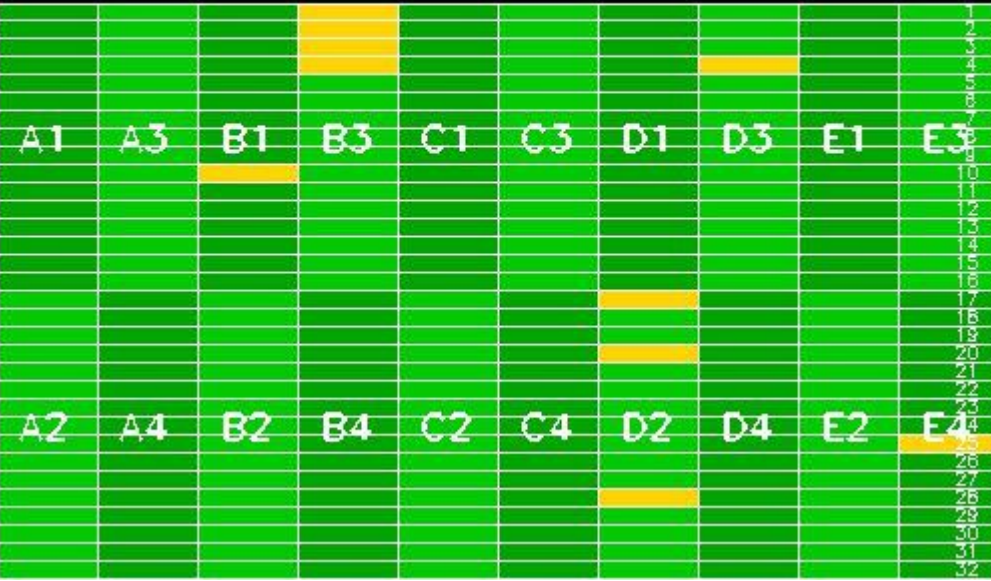

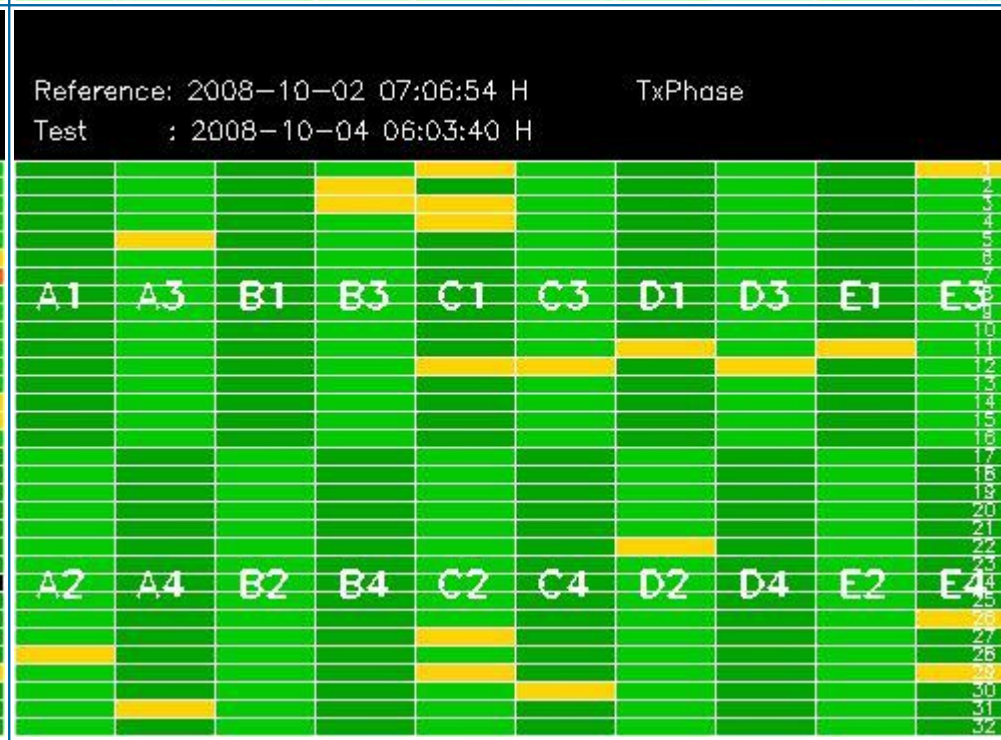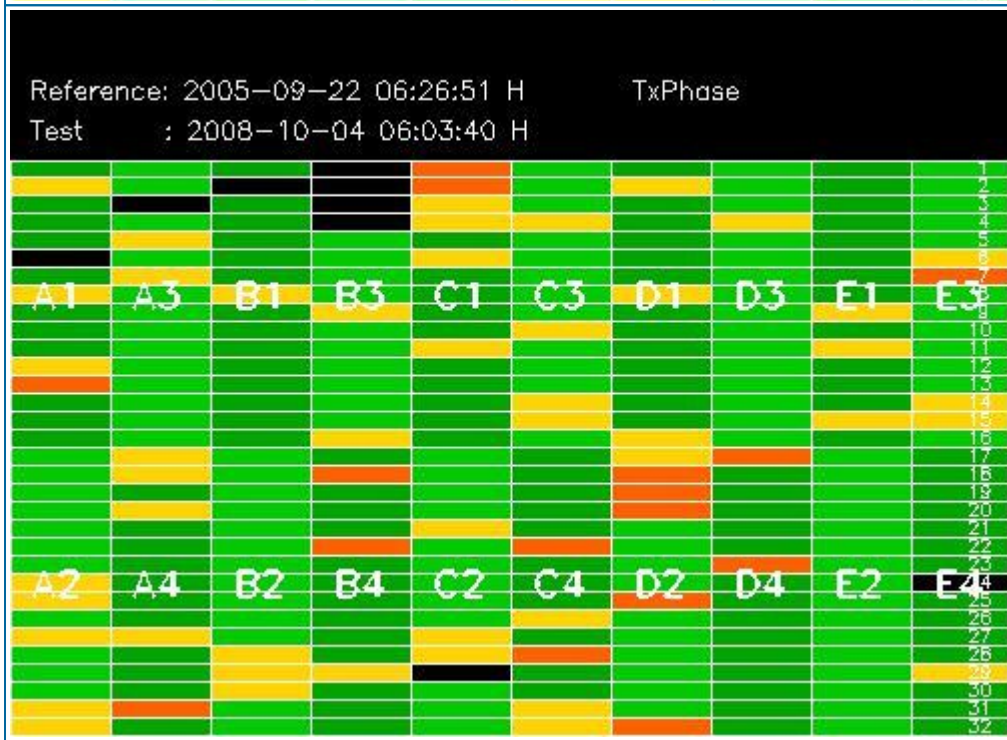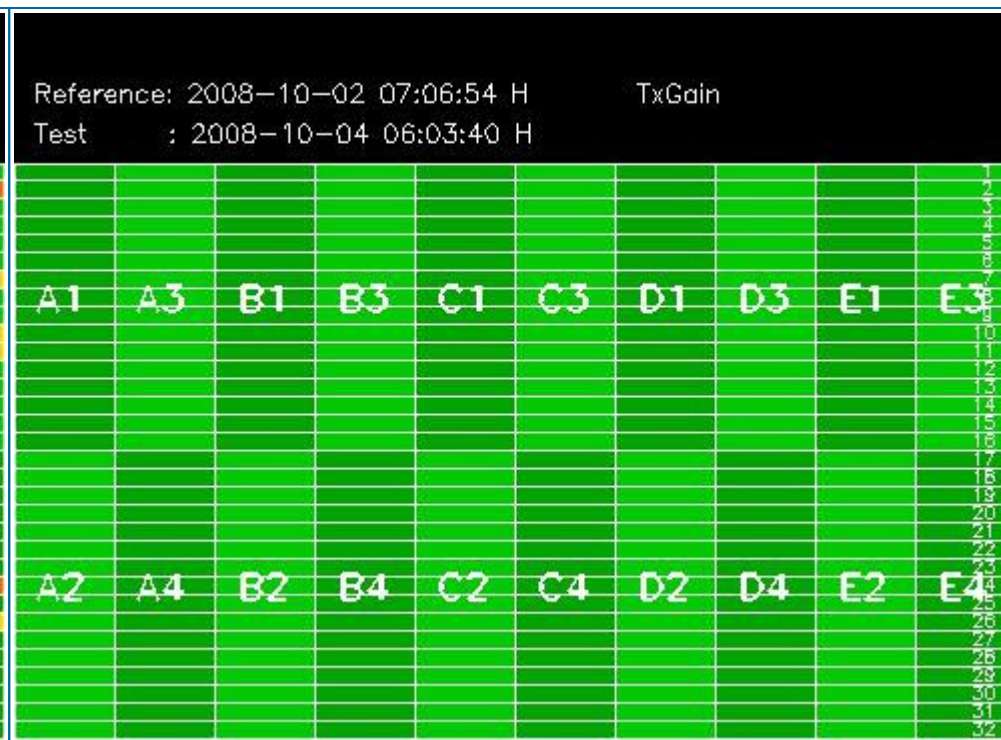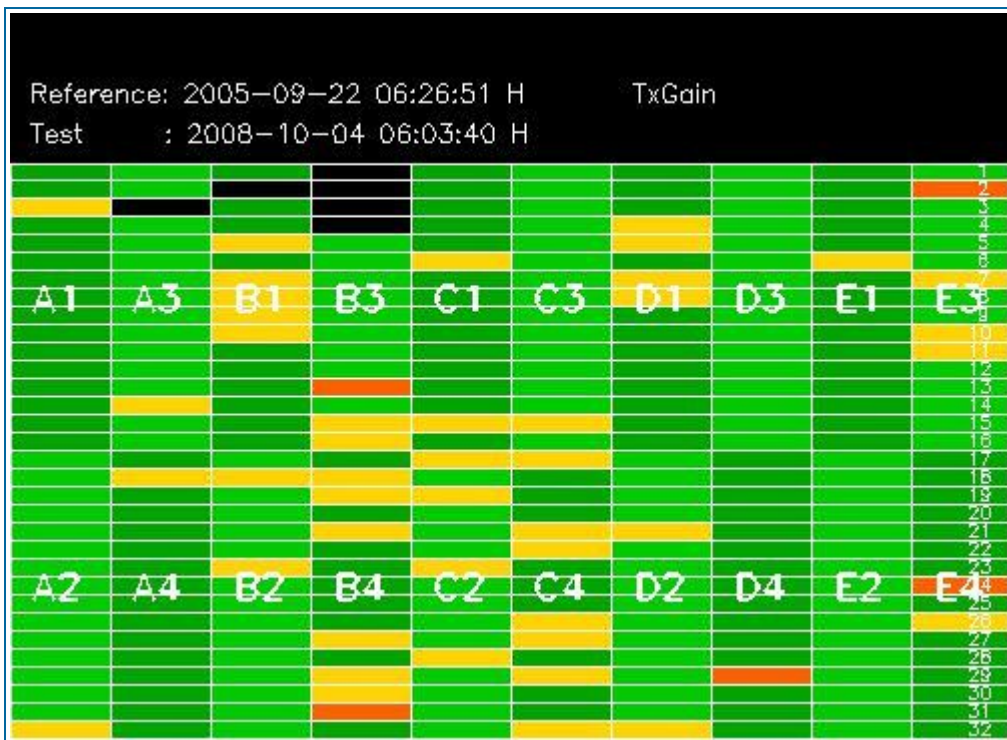

4 - CALIBRATION PULSES ANALYSIS

4.1 - Analysis for WVS IS2 V/V


4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for WVS IS2 V/V

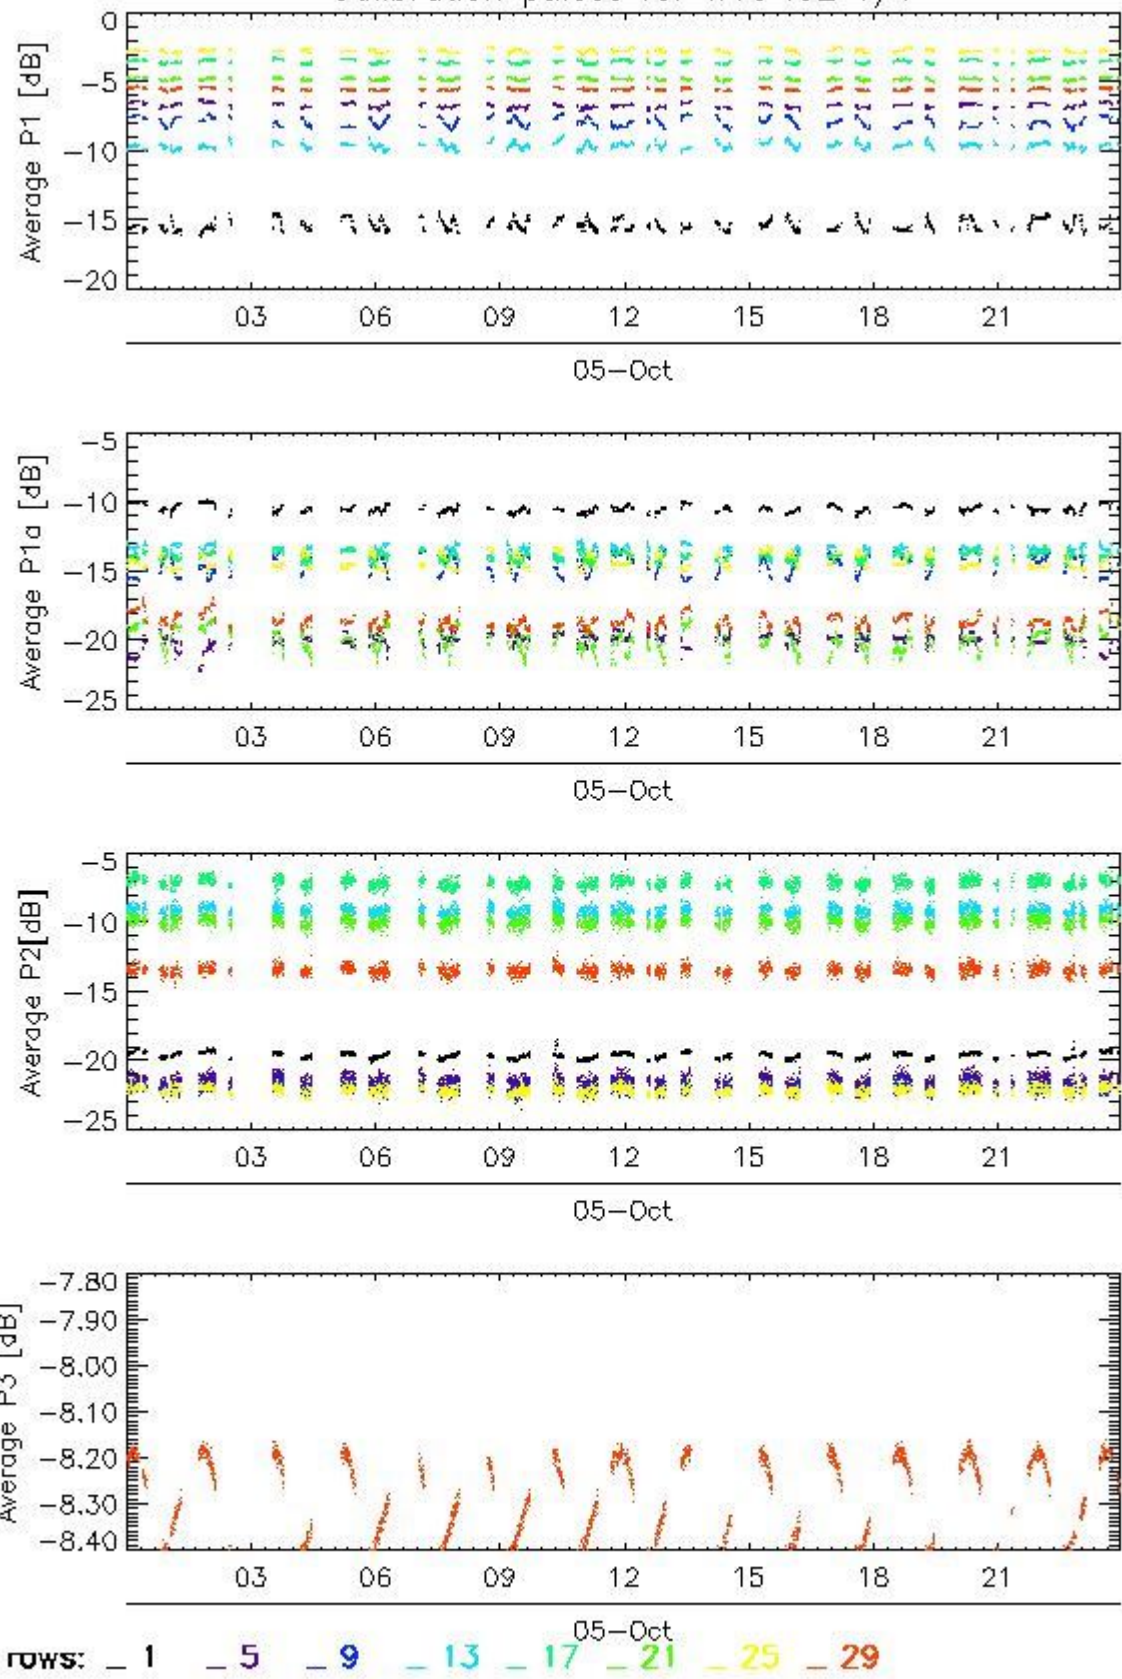


Transmit power (P1 - P1a) for WVS IS2 V/V

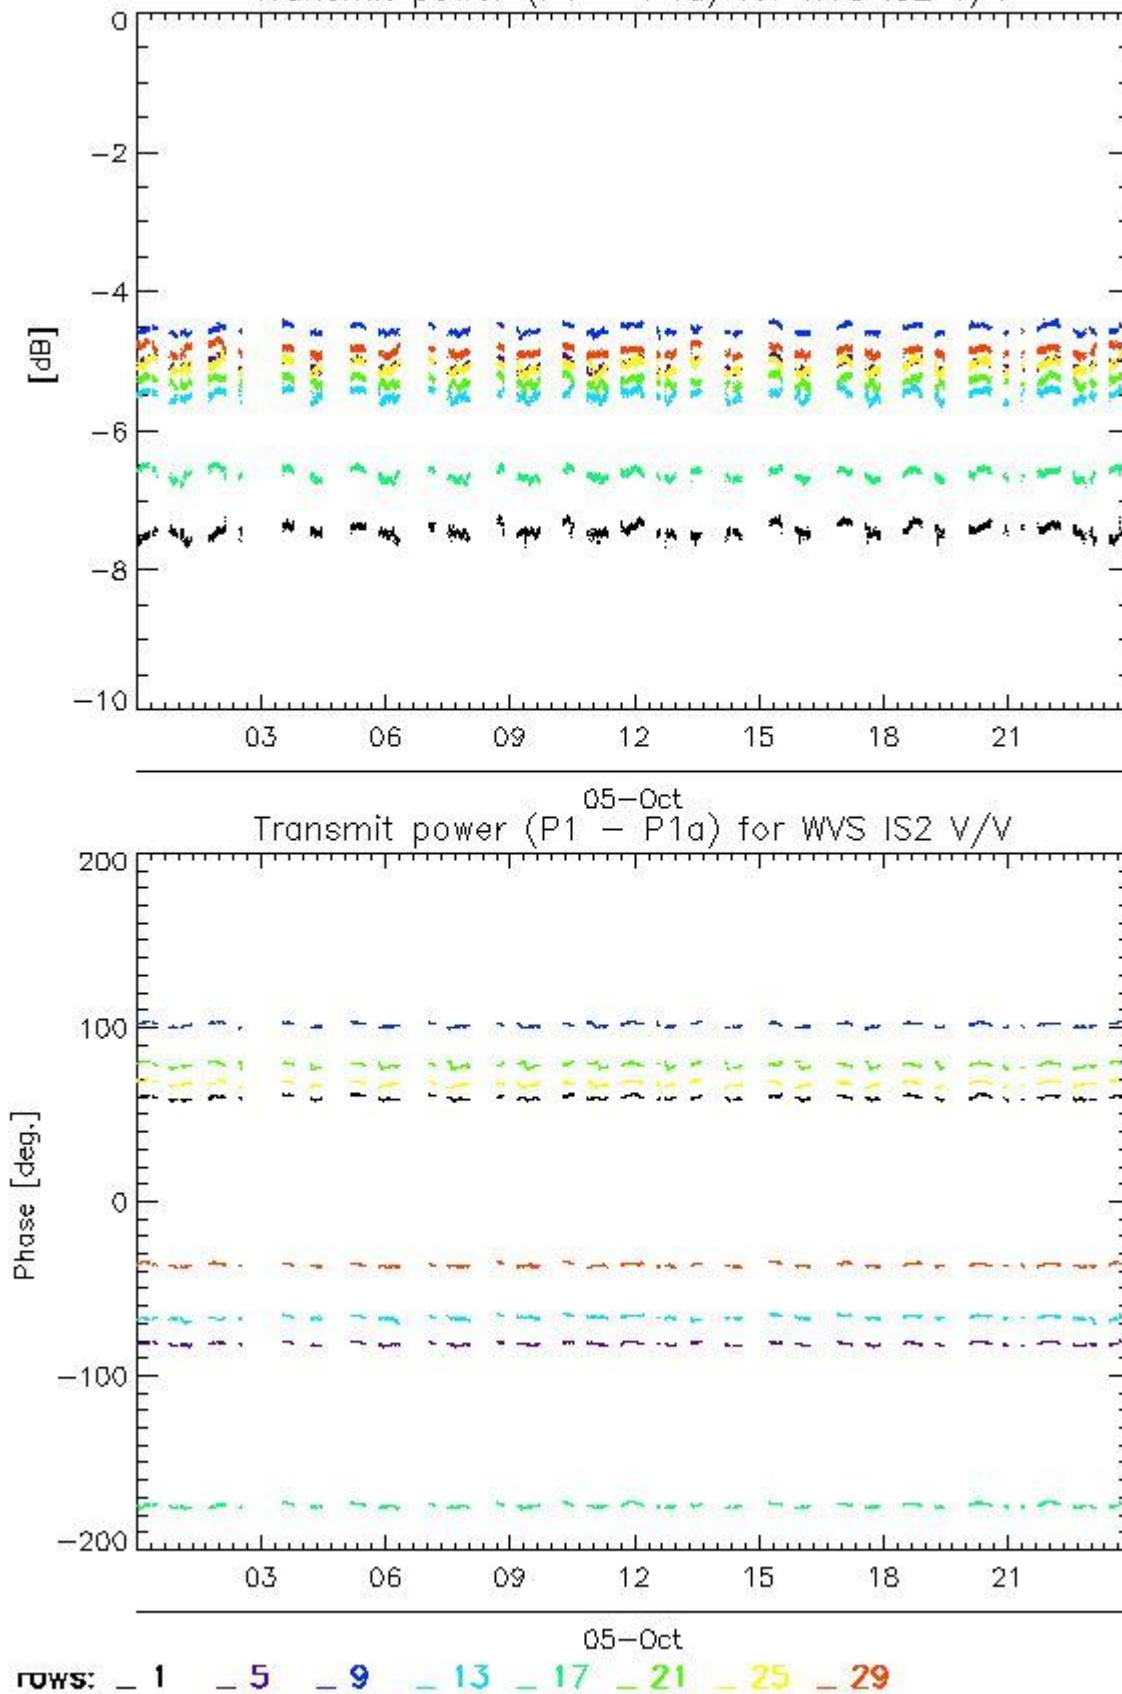

4.1.2 - All Rows Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



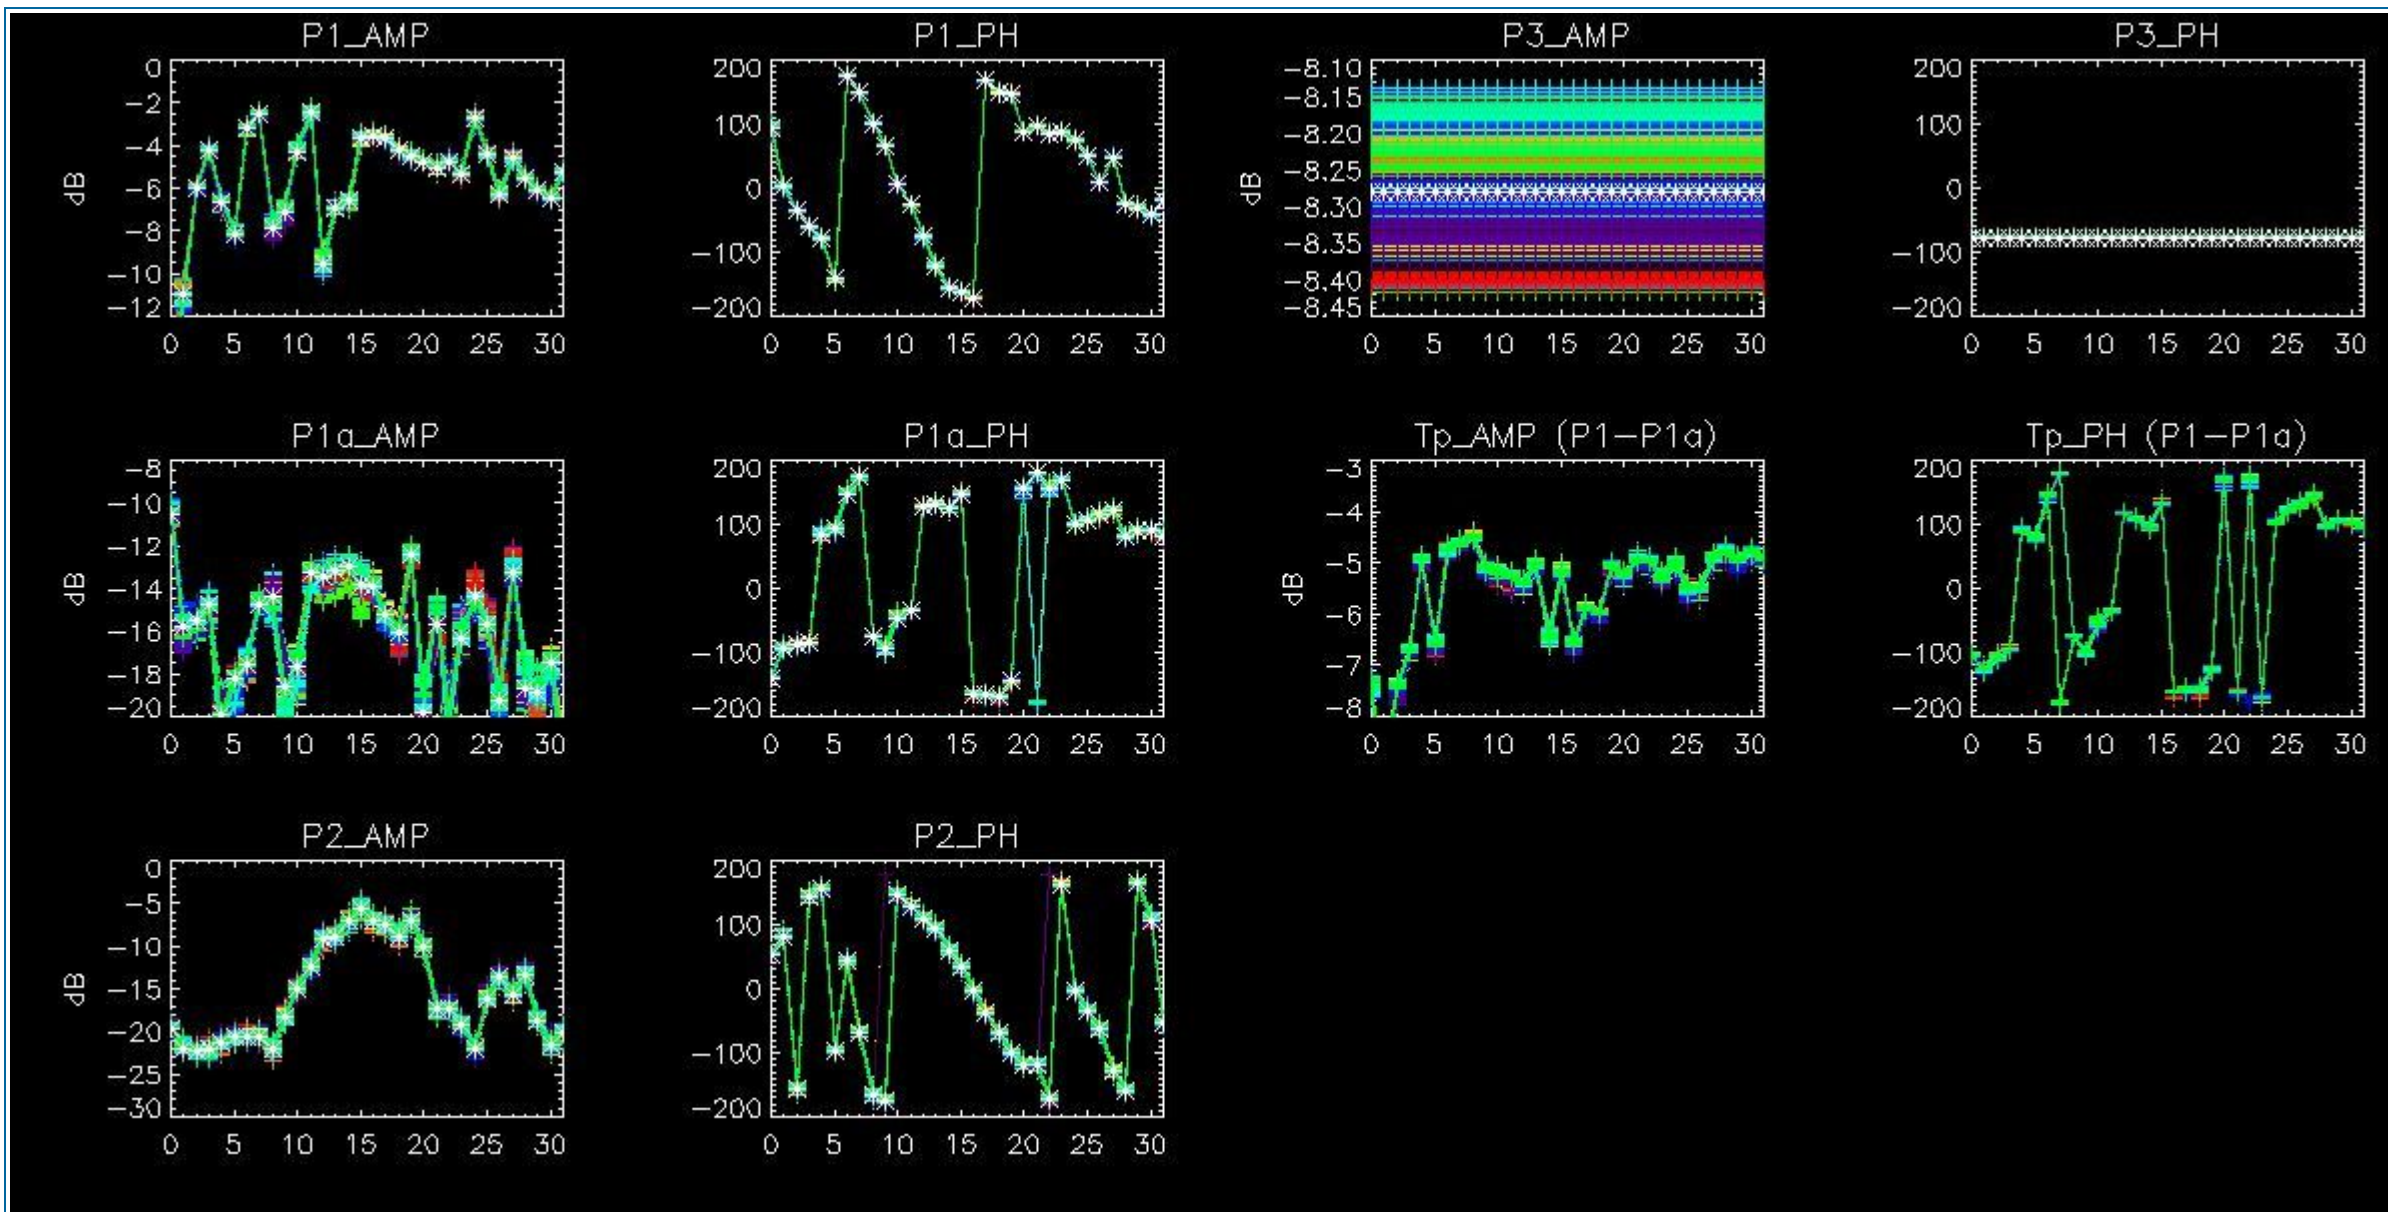

4.2 - Analysis for GM1 SS3 H/H


4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for GM1 SS3 H/H

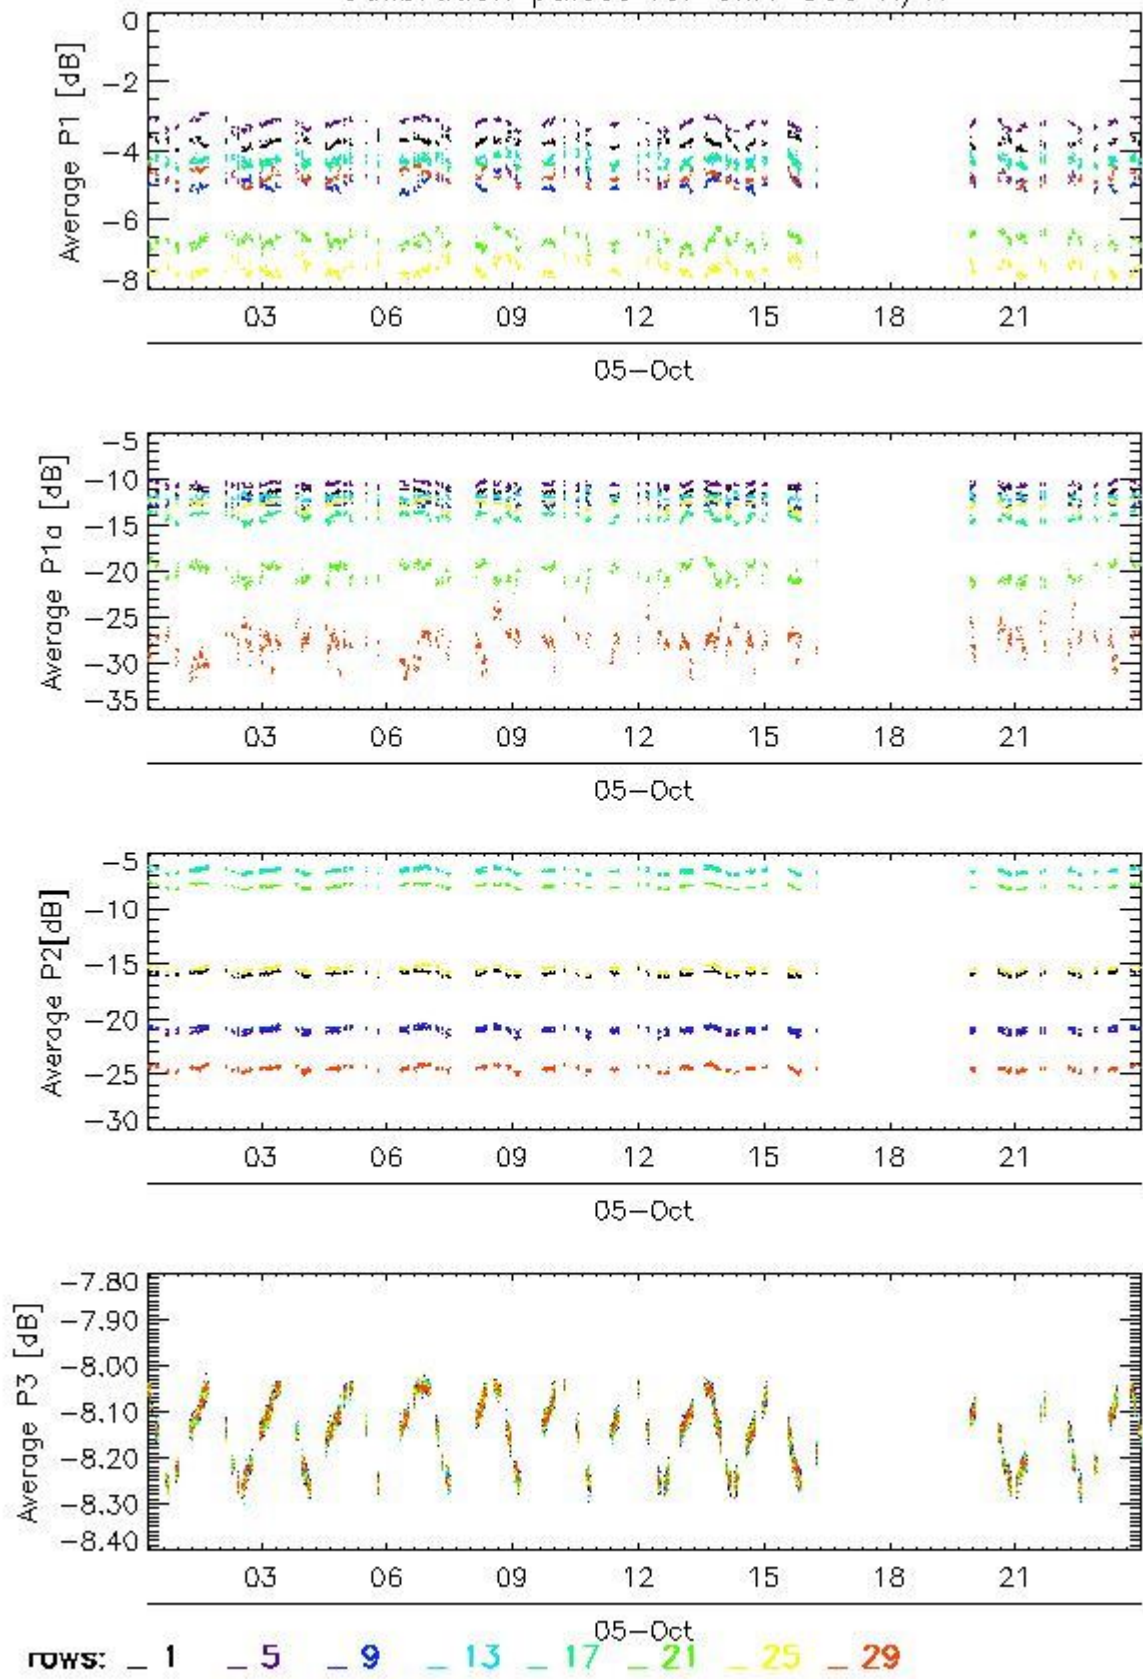


Transmit power (P1 - P1a) for GM1 SS3 H/H

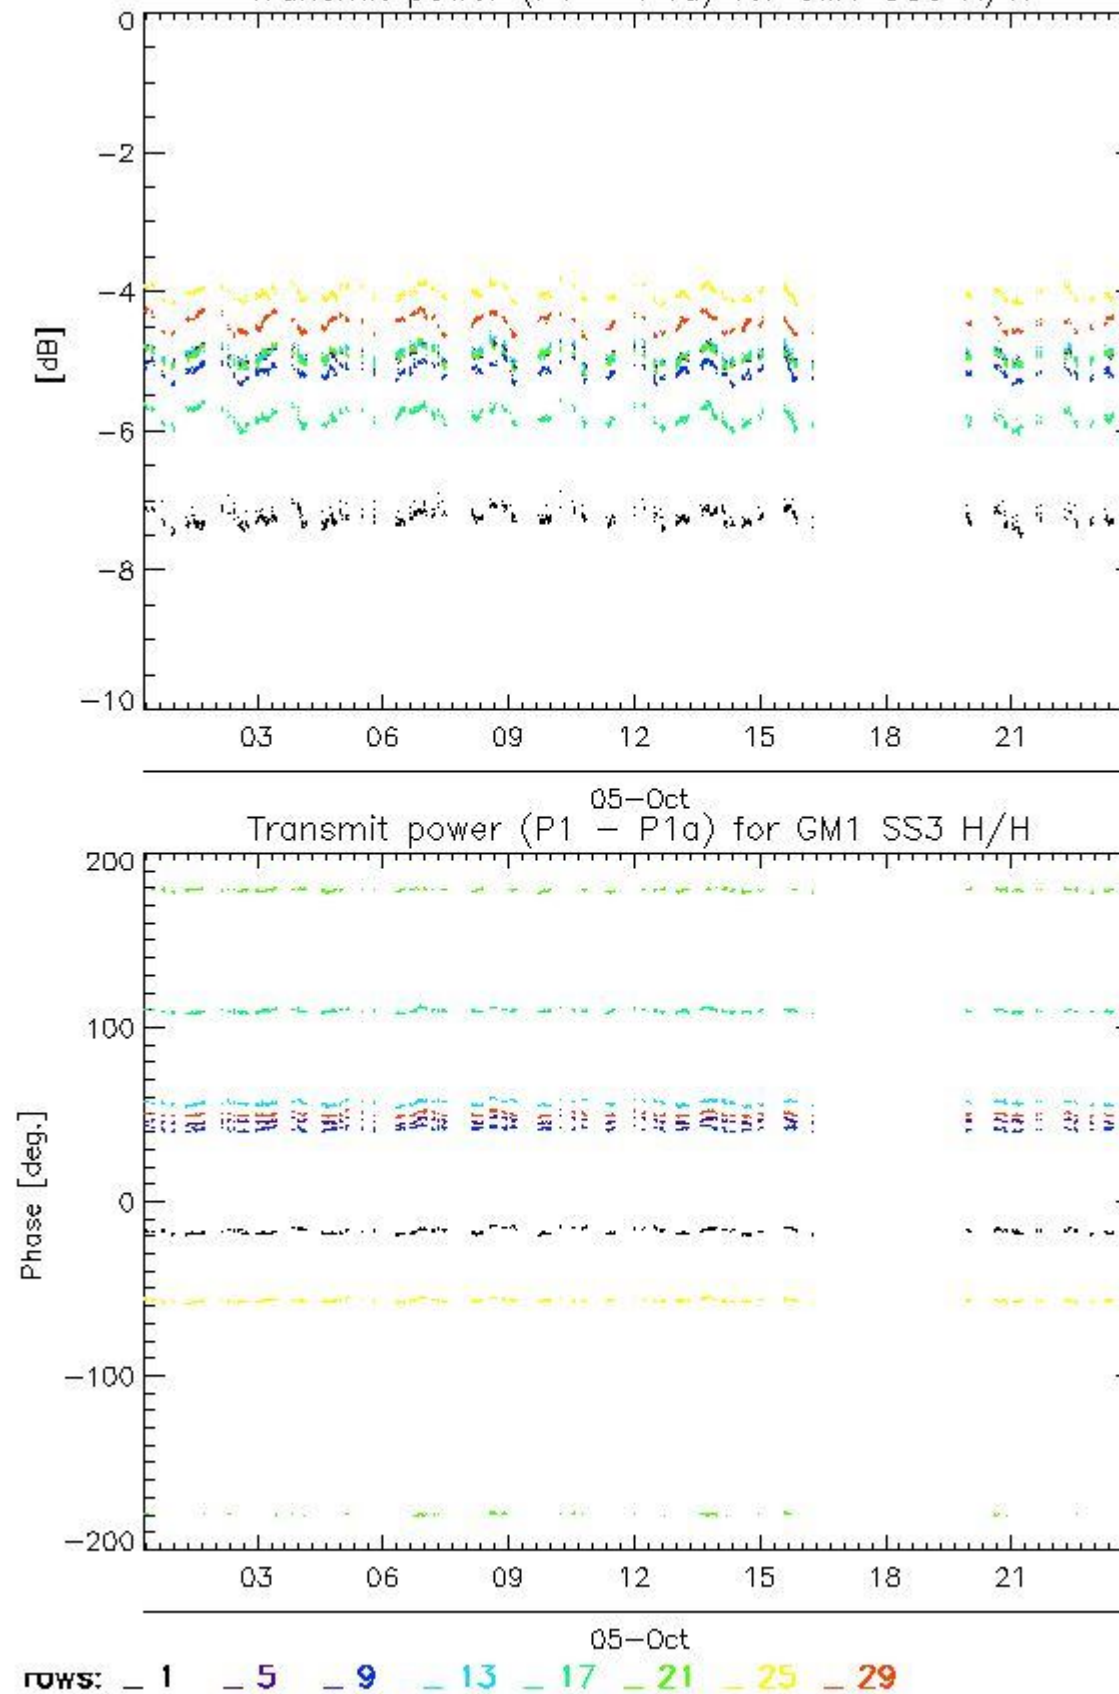

4.2.2 - All Rows Analysis for GM1 SS3 H/H

[[BACK TO MENU](#)]



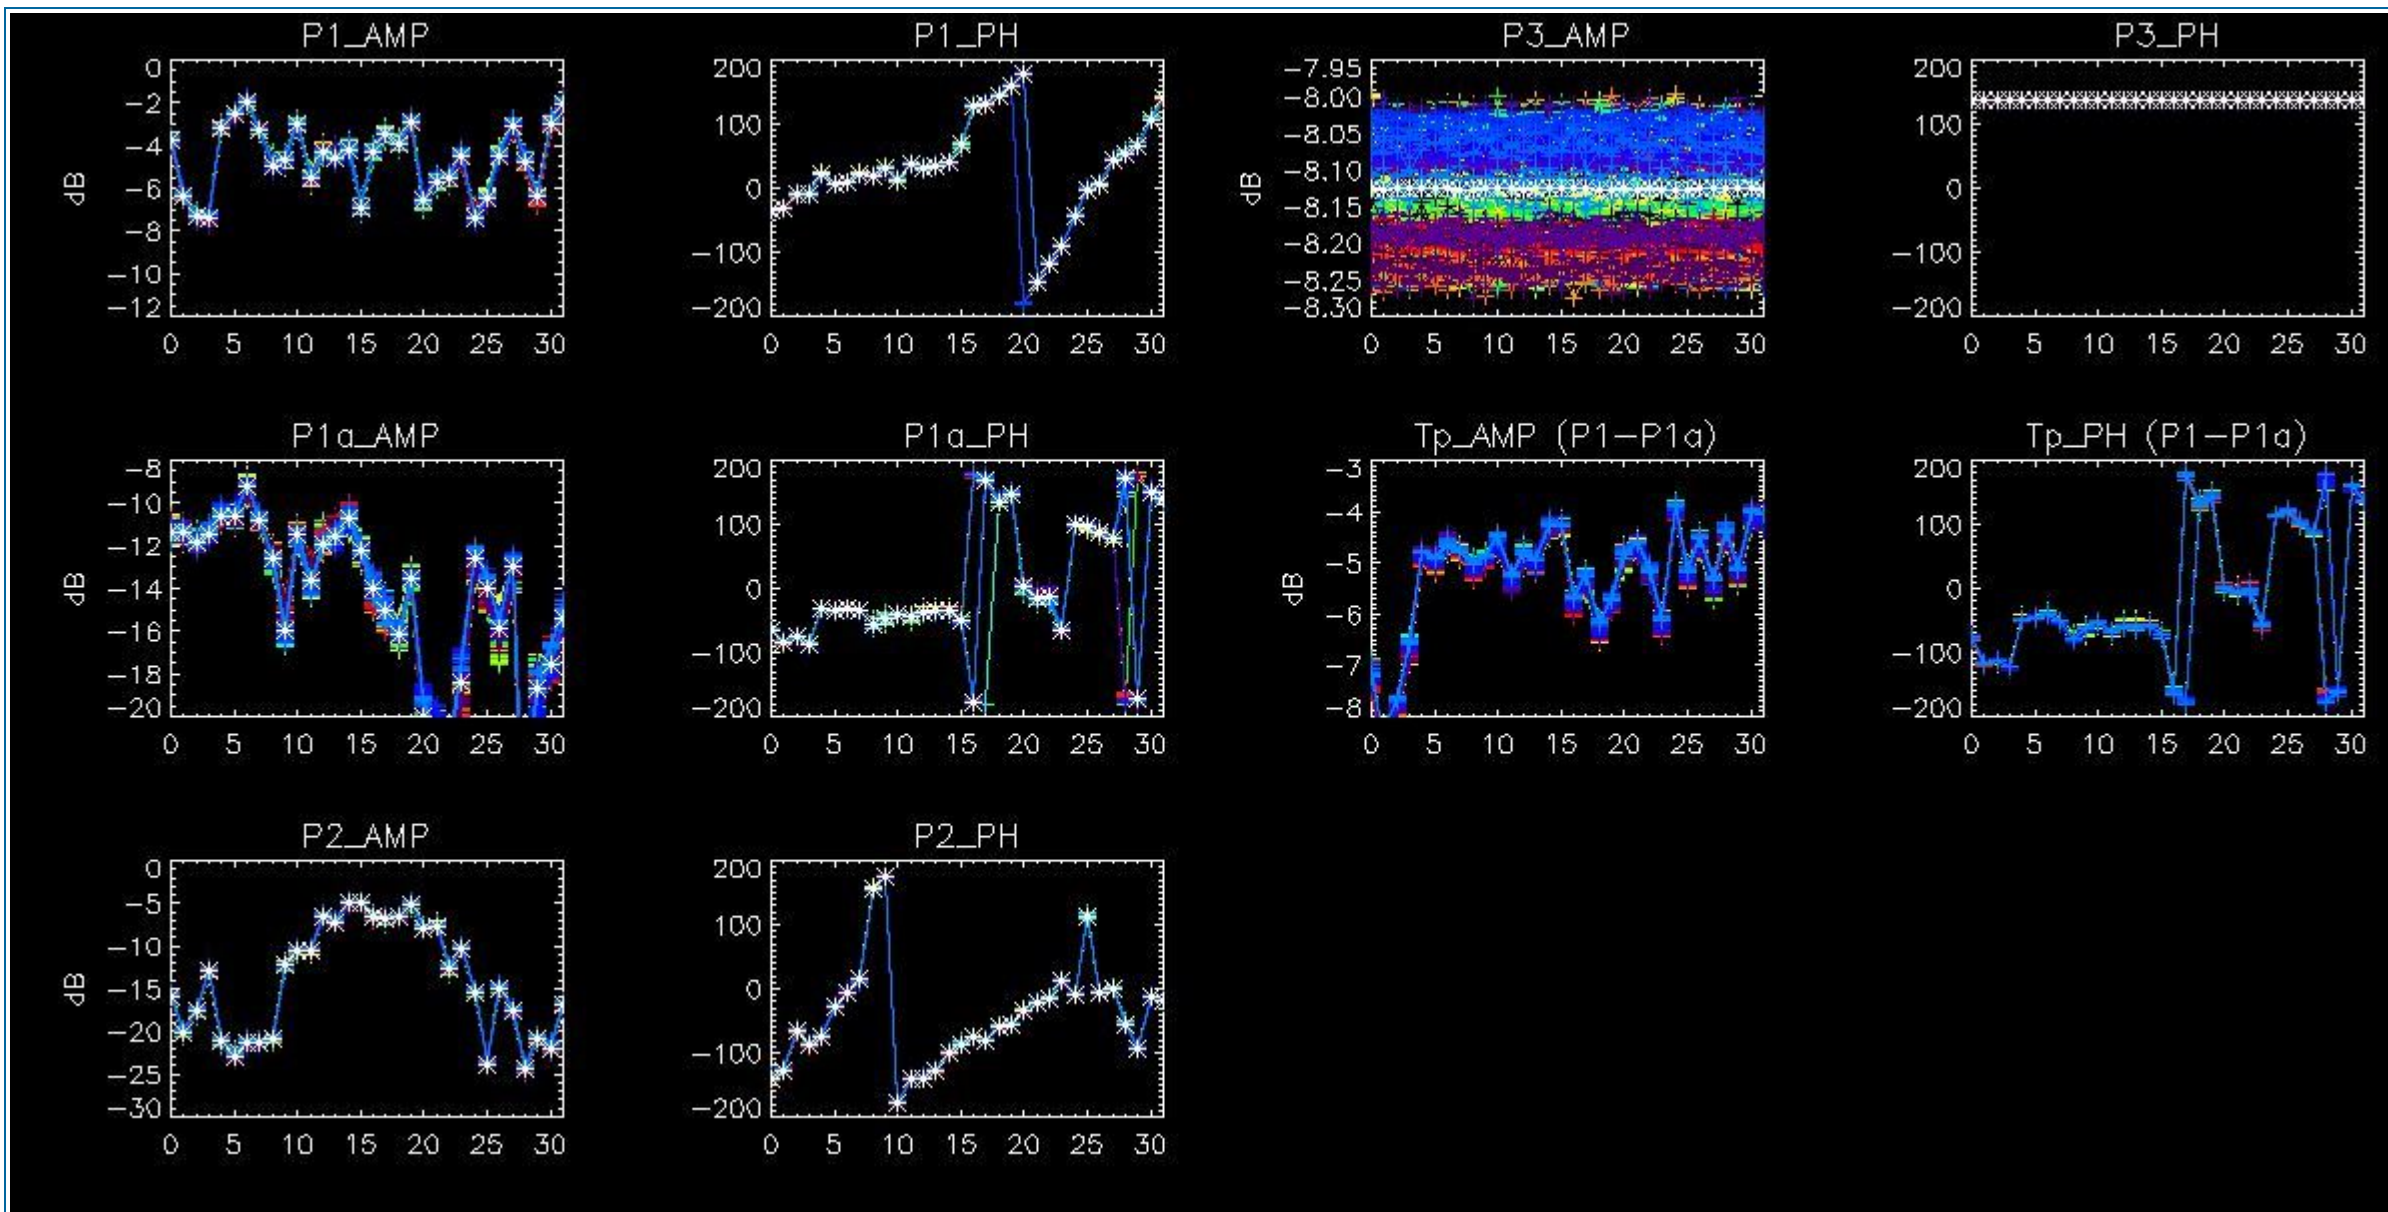


5 - DOPPLER ANALYSIS

5.1 - Analysis for WVS IS2 V/V

5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]




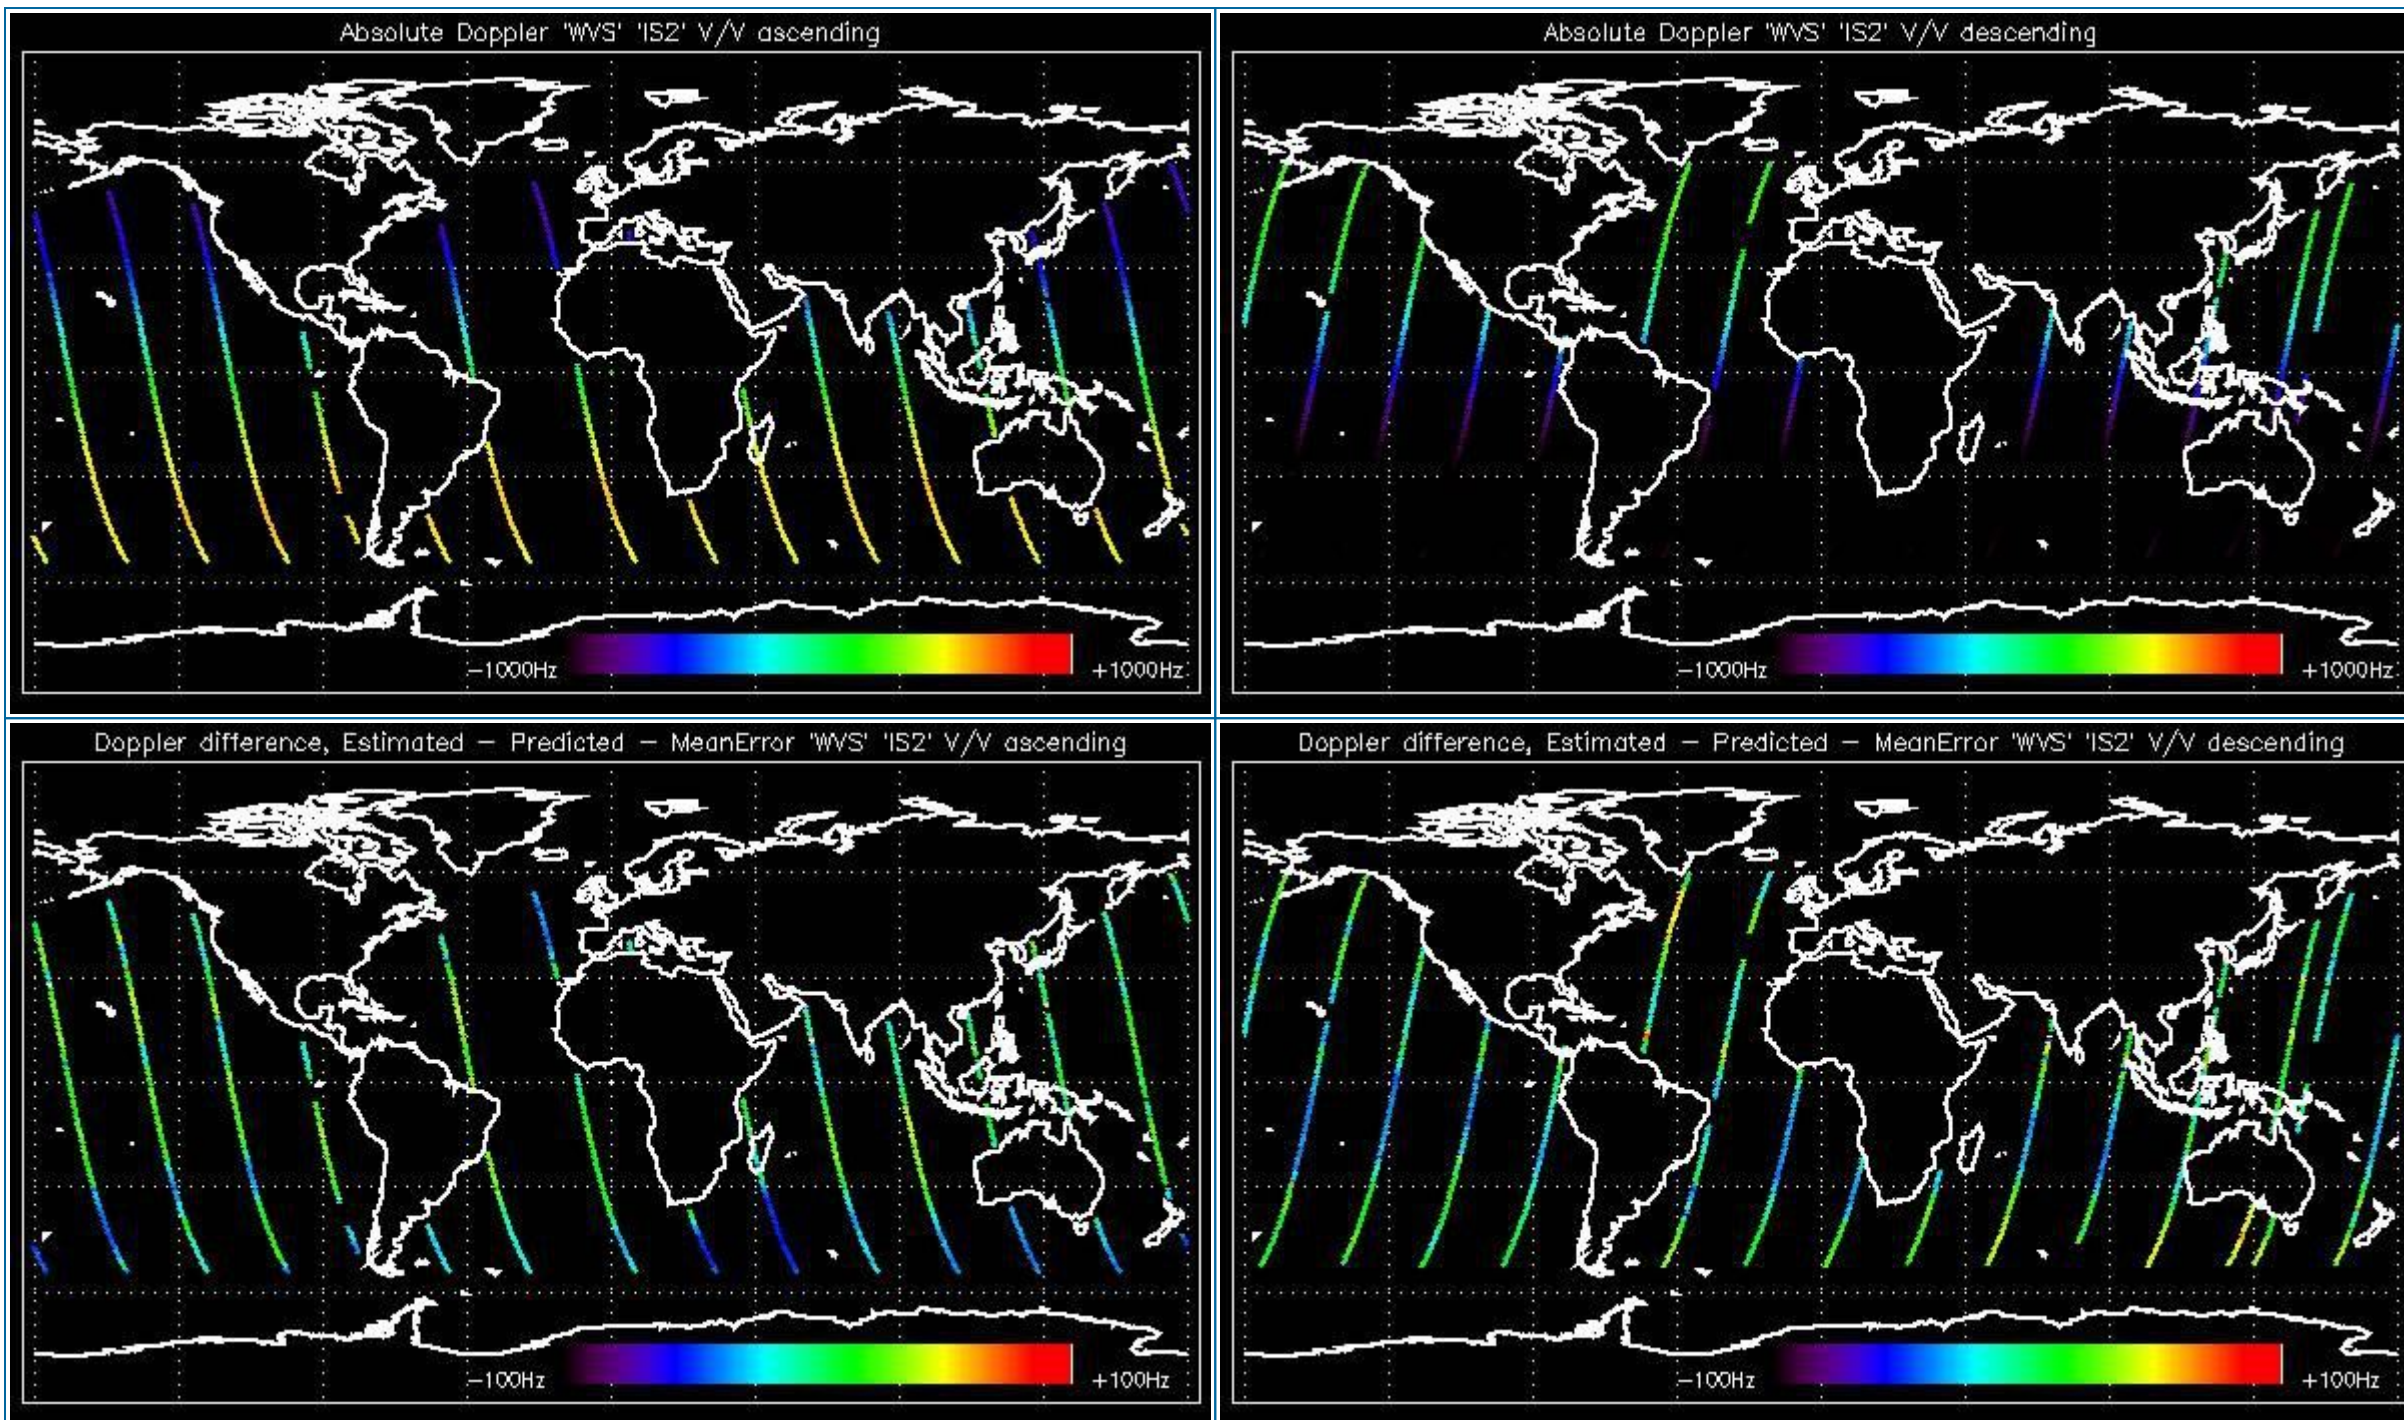

5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



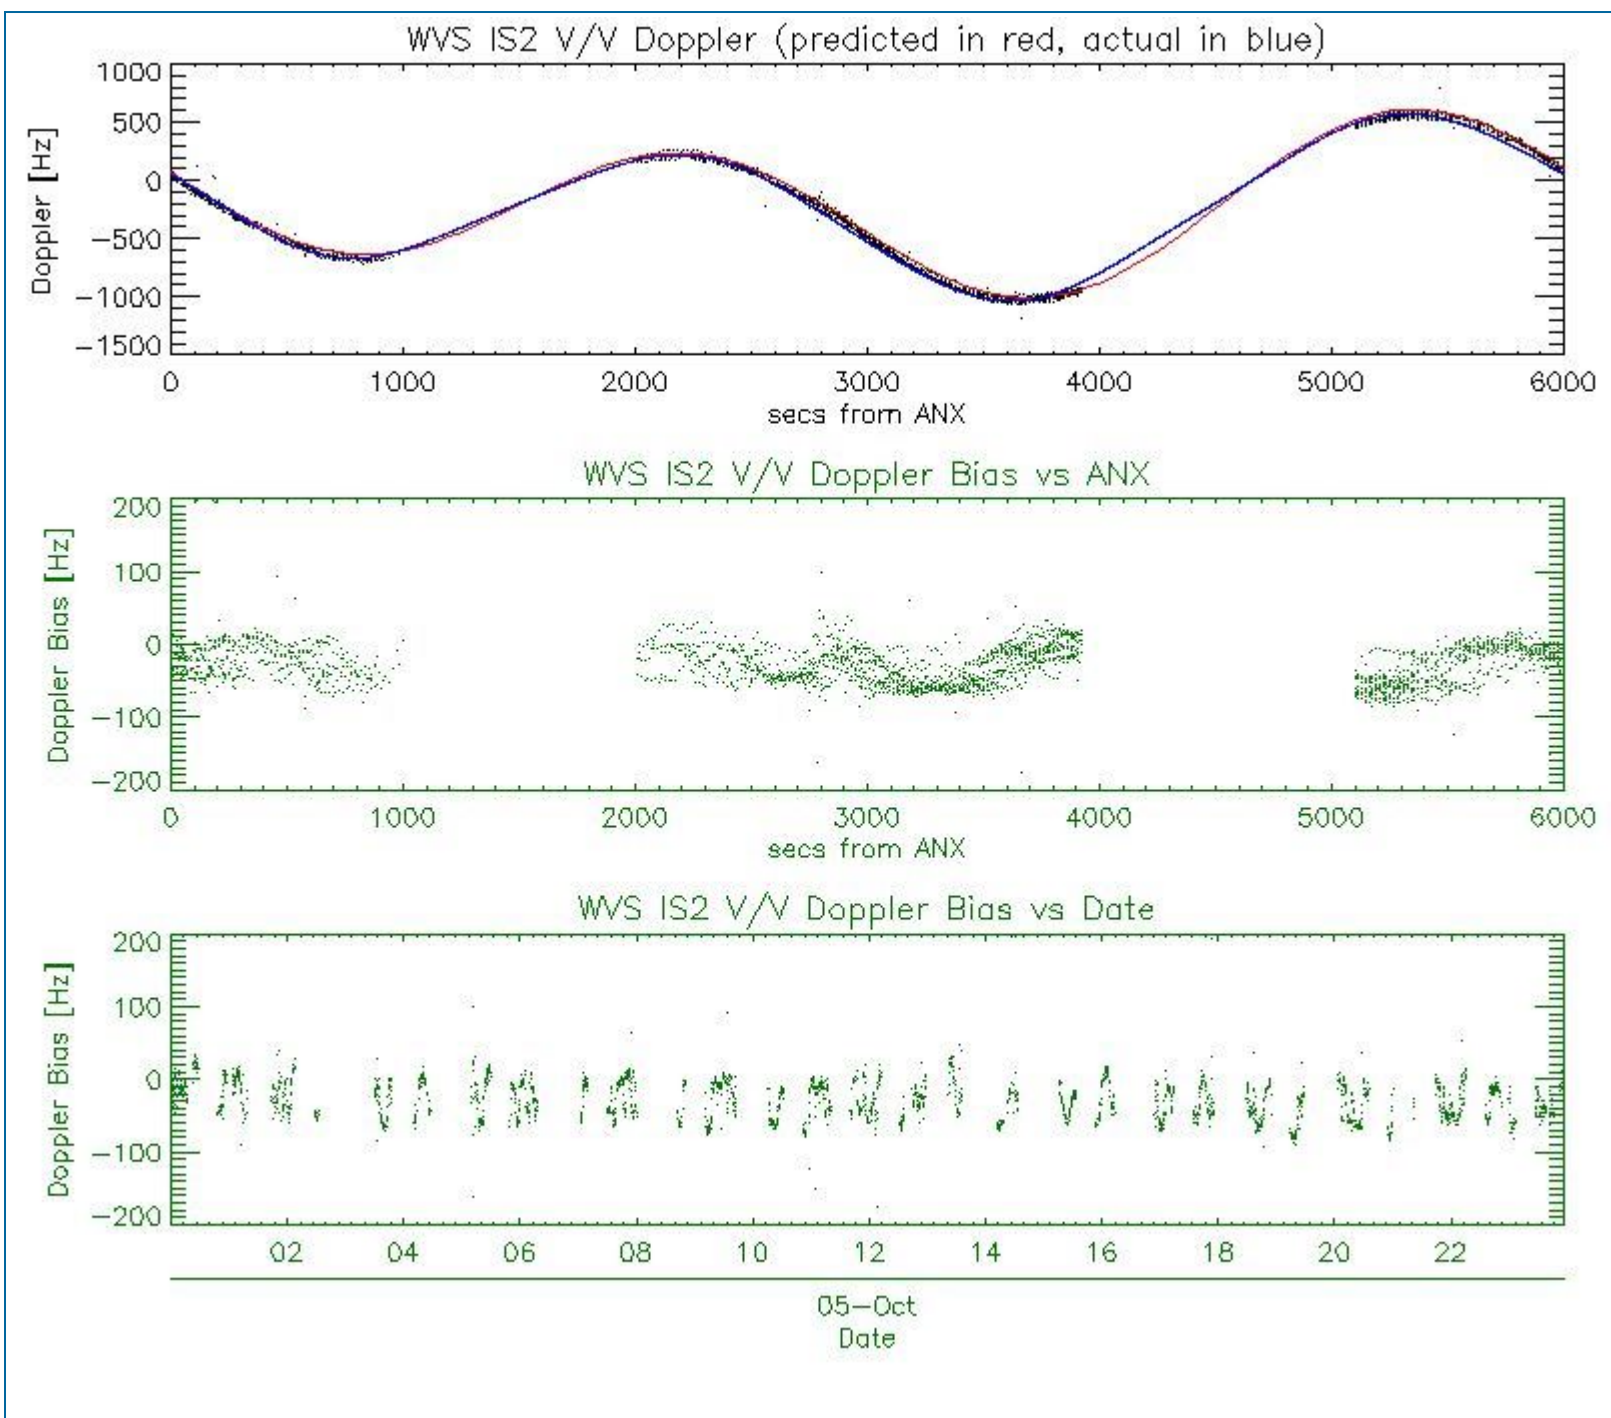


5.2 - Analysis for GM1 SS1 H/H

5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




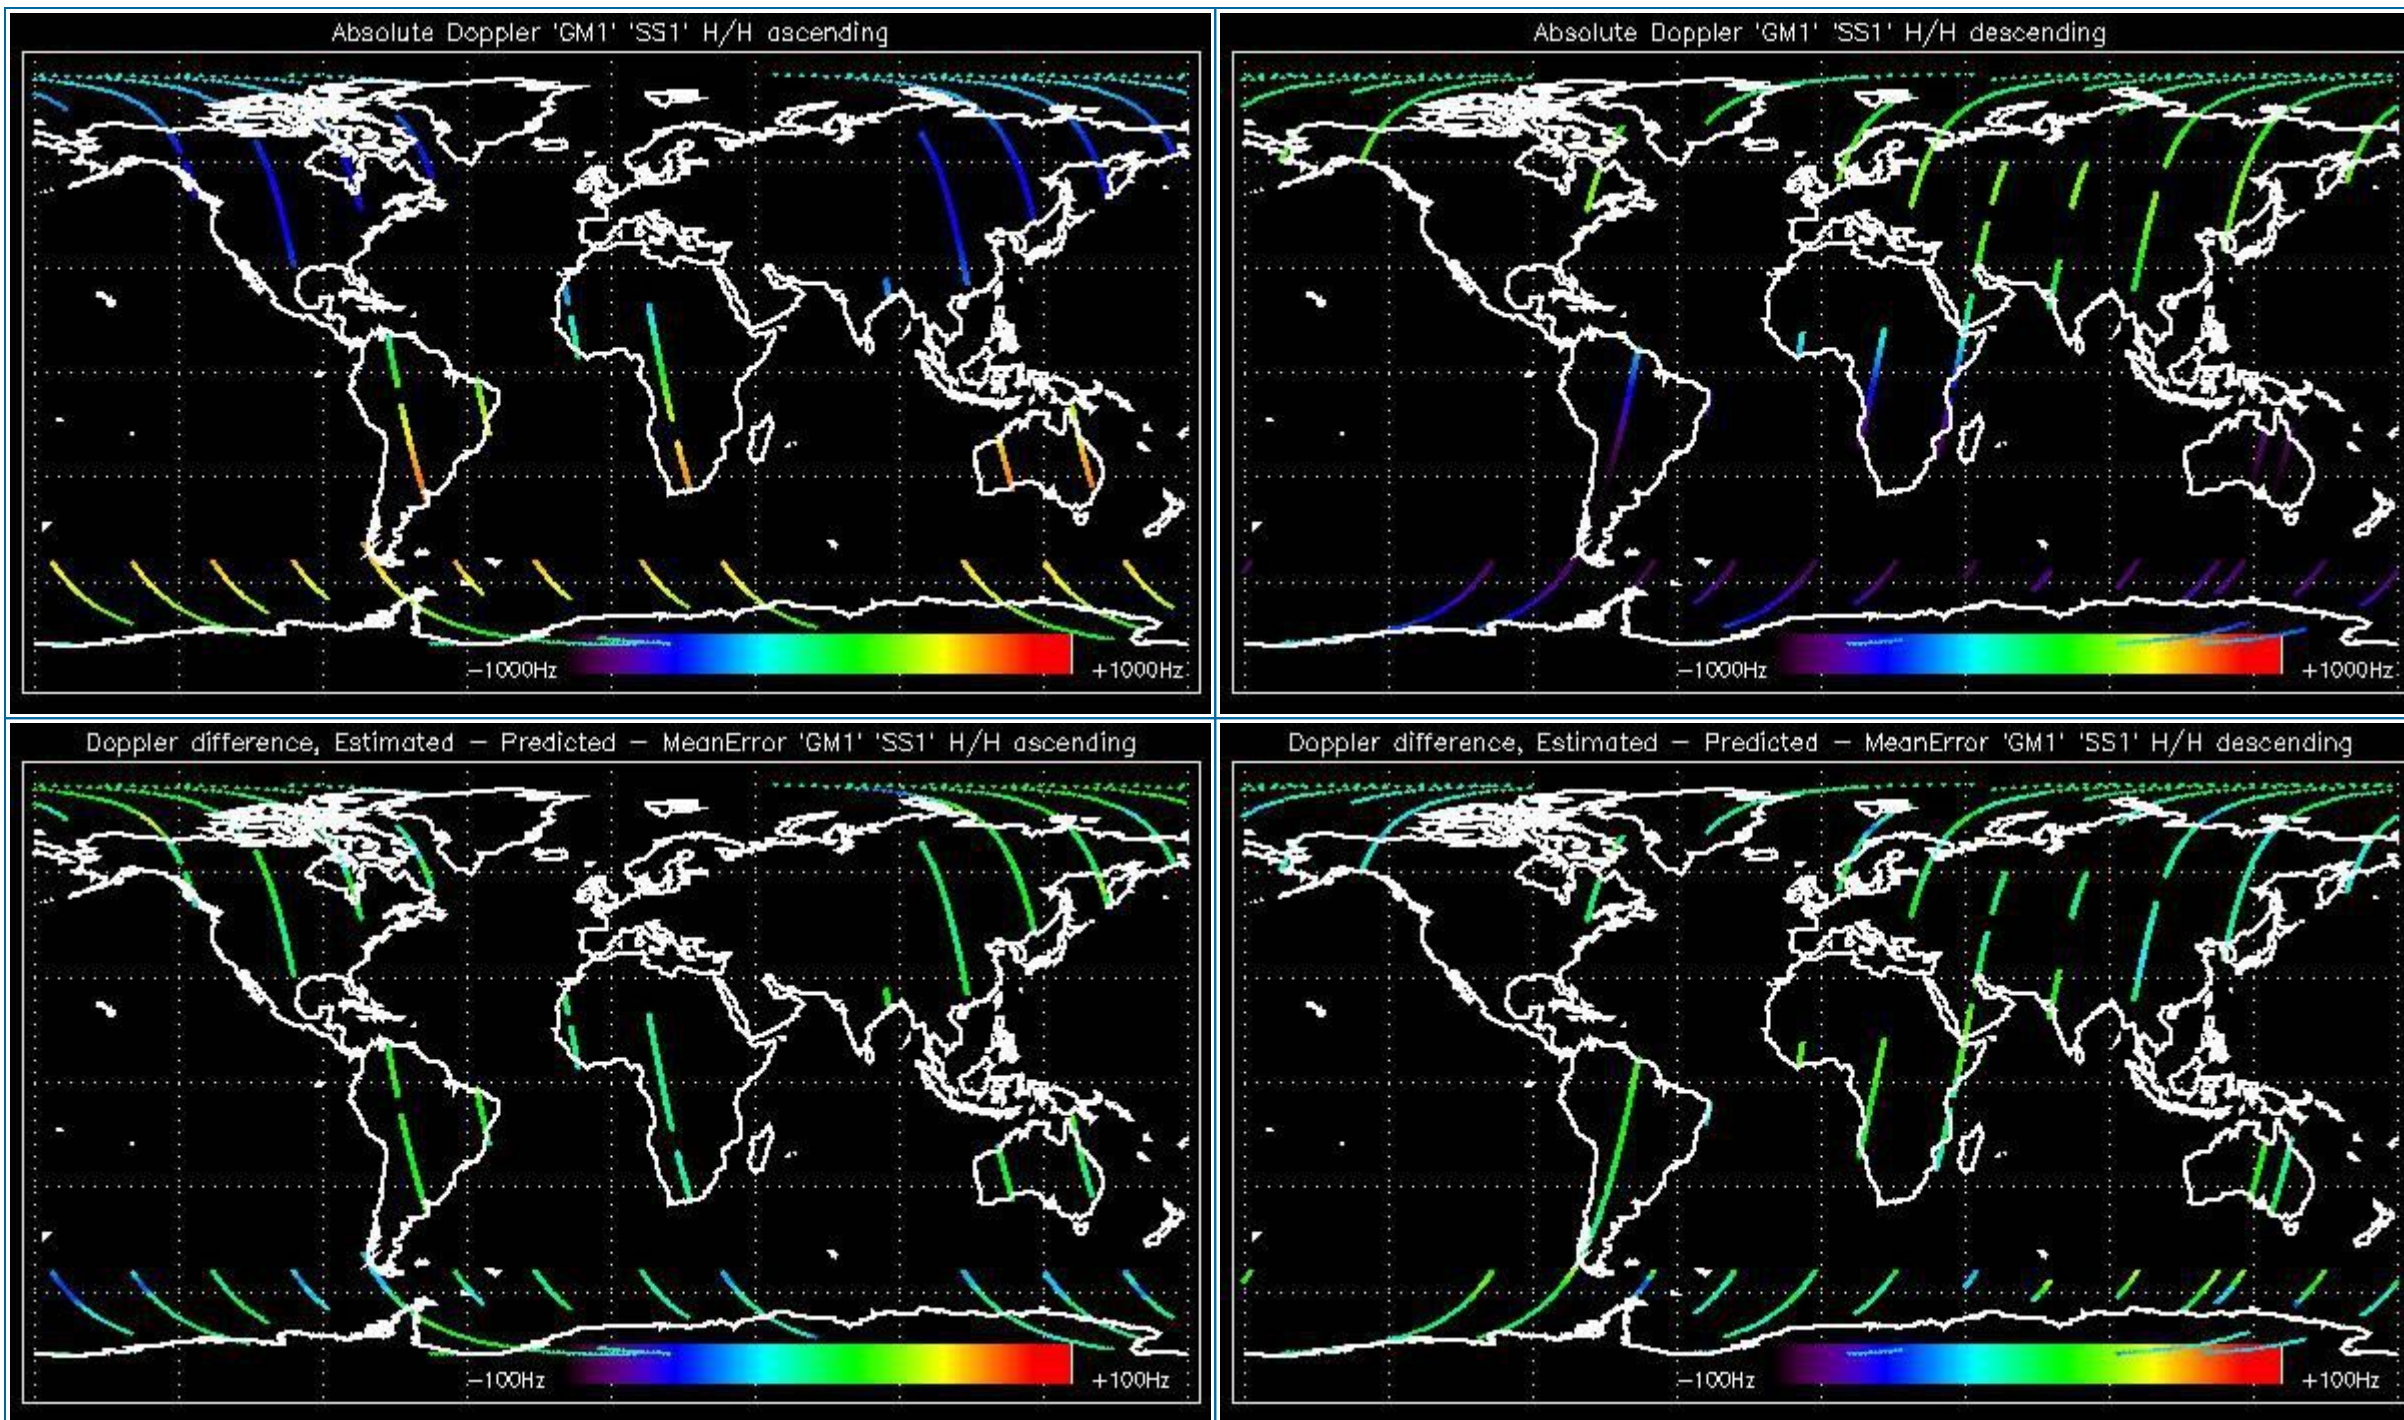

5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




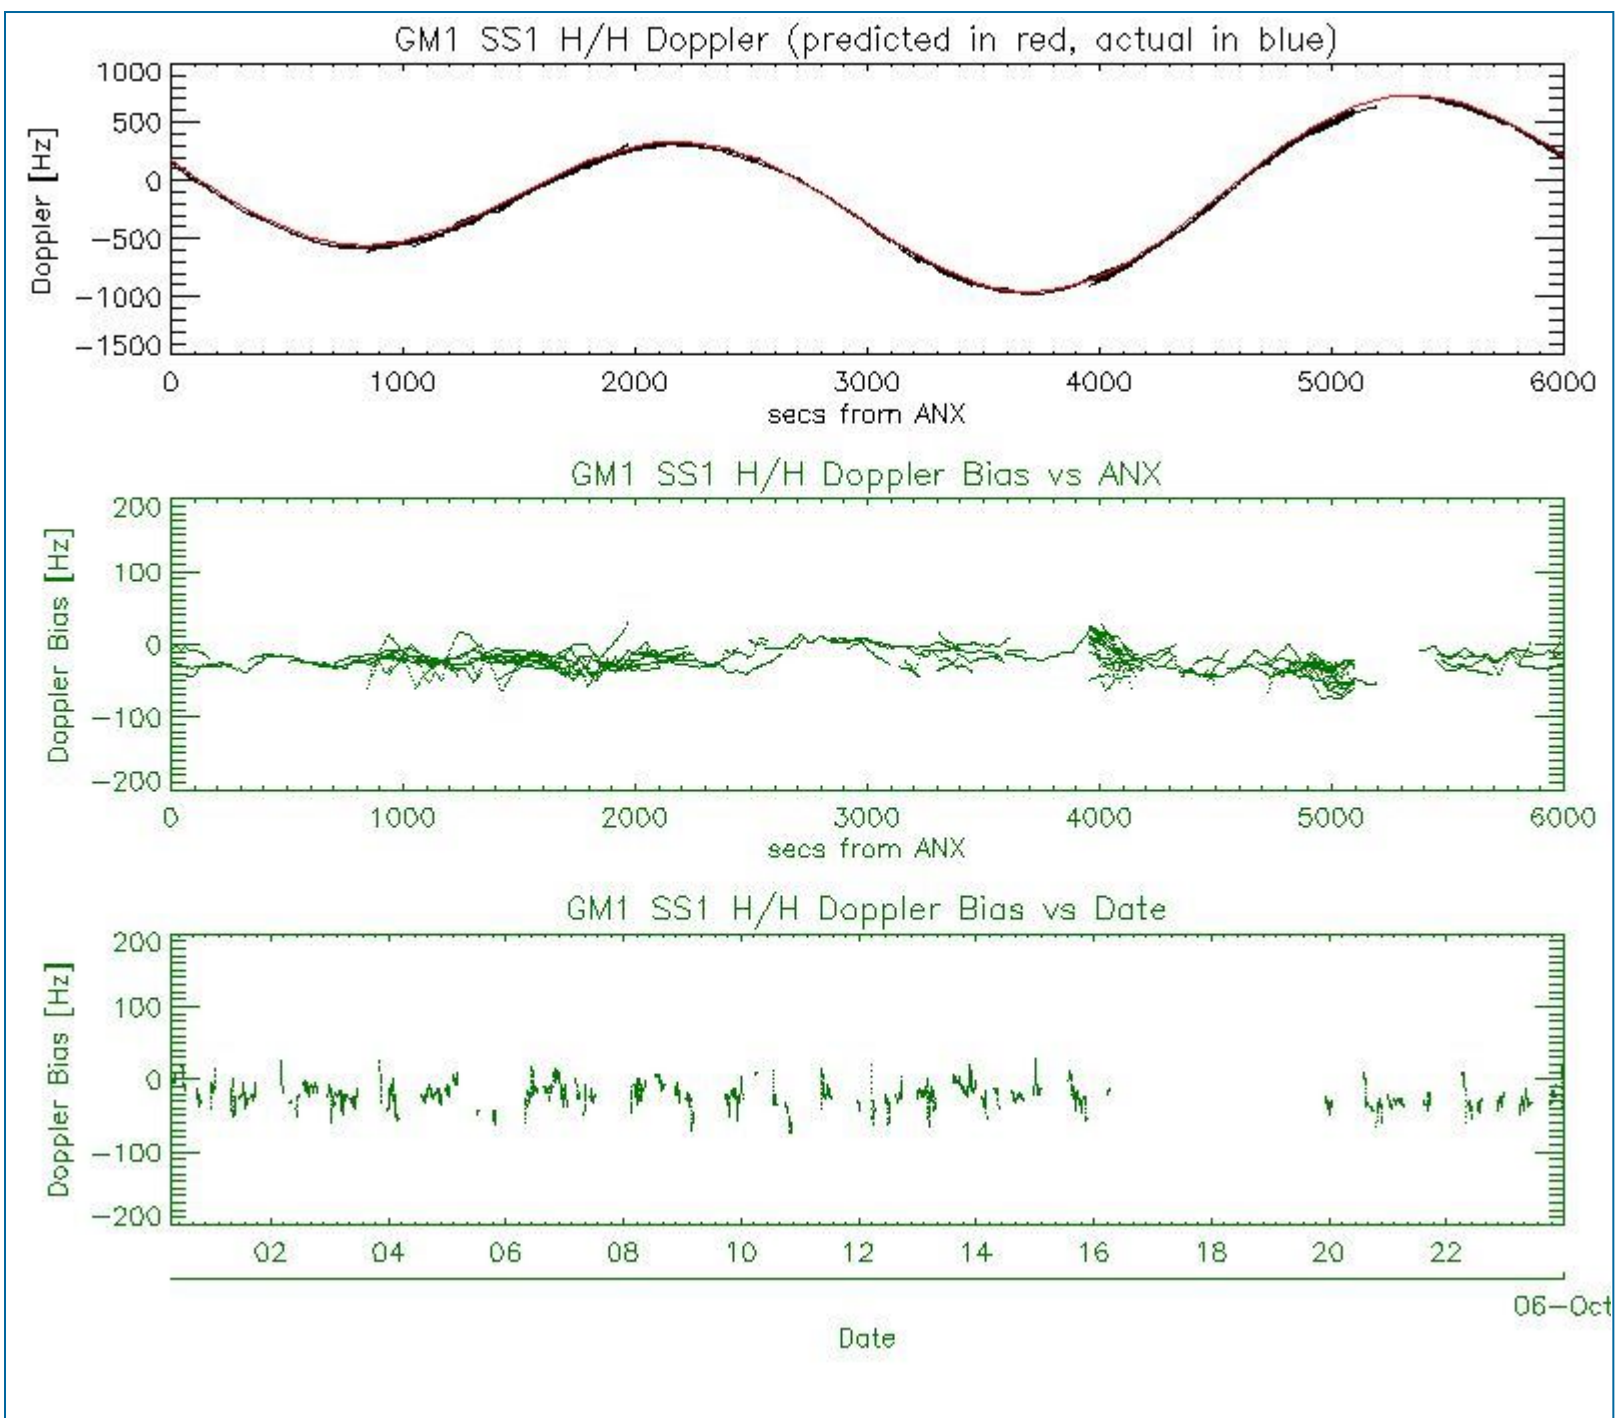

5.3 - Doppler JUMPS Analysis for WSM

[[BACK TO MENU](#)]



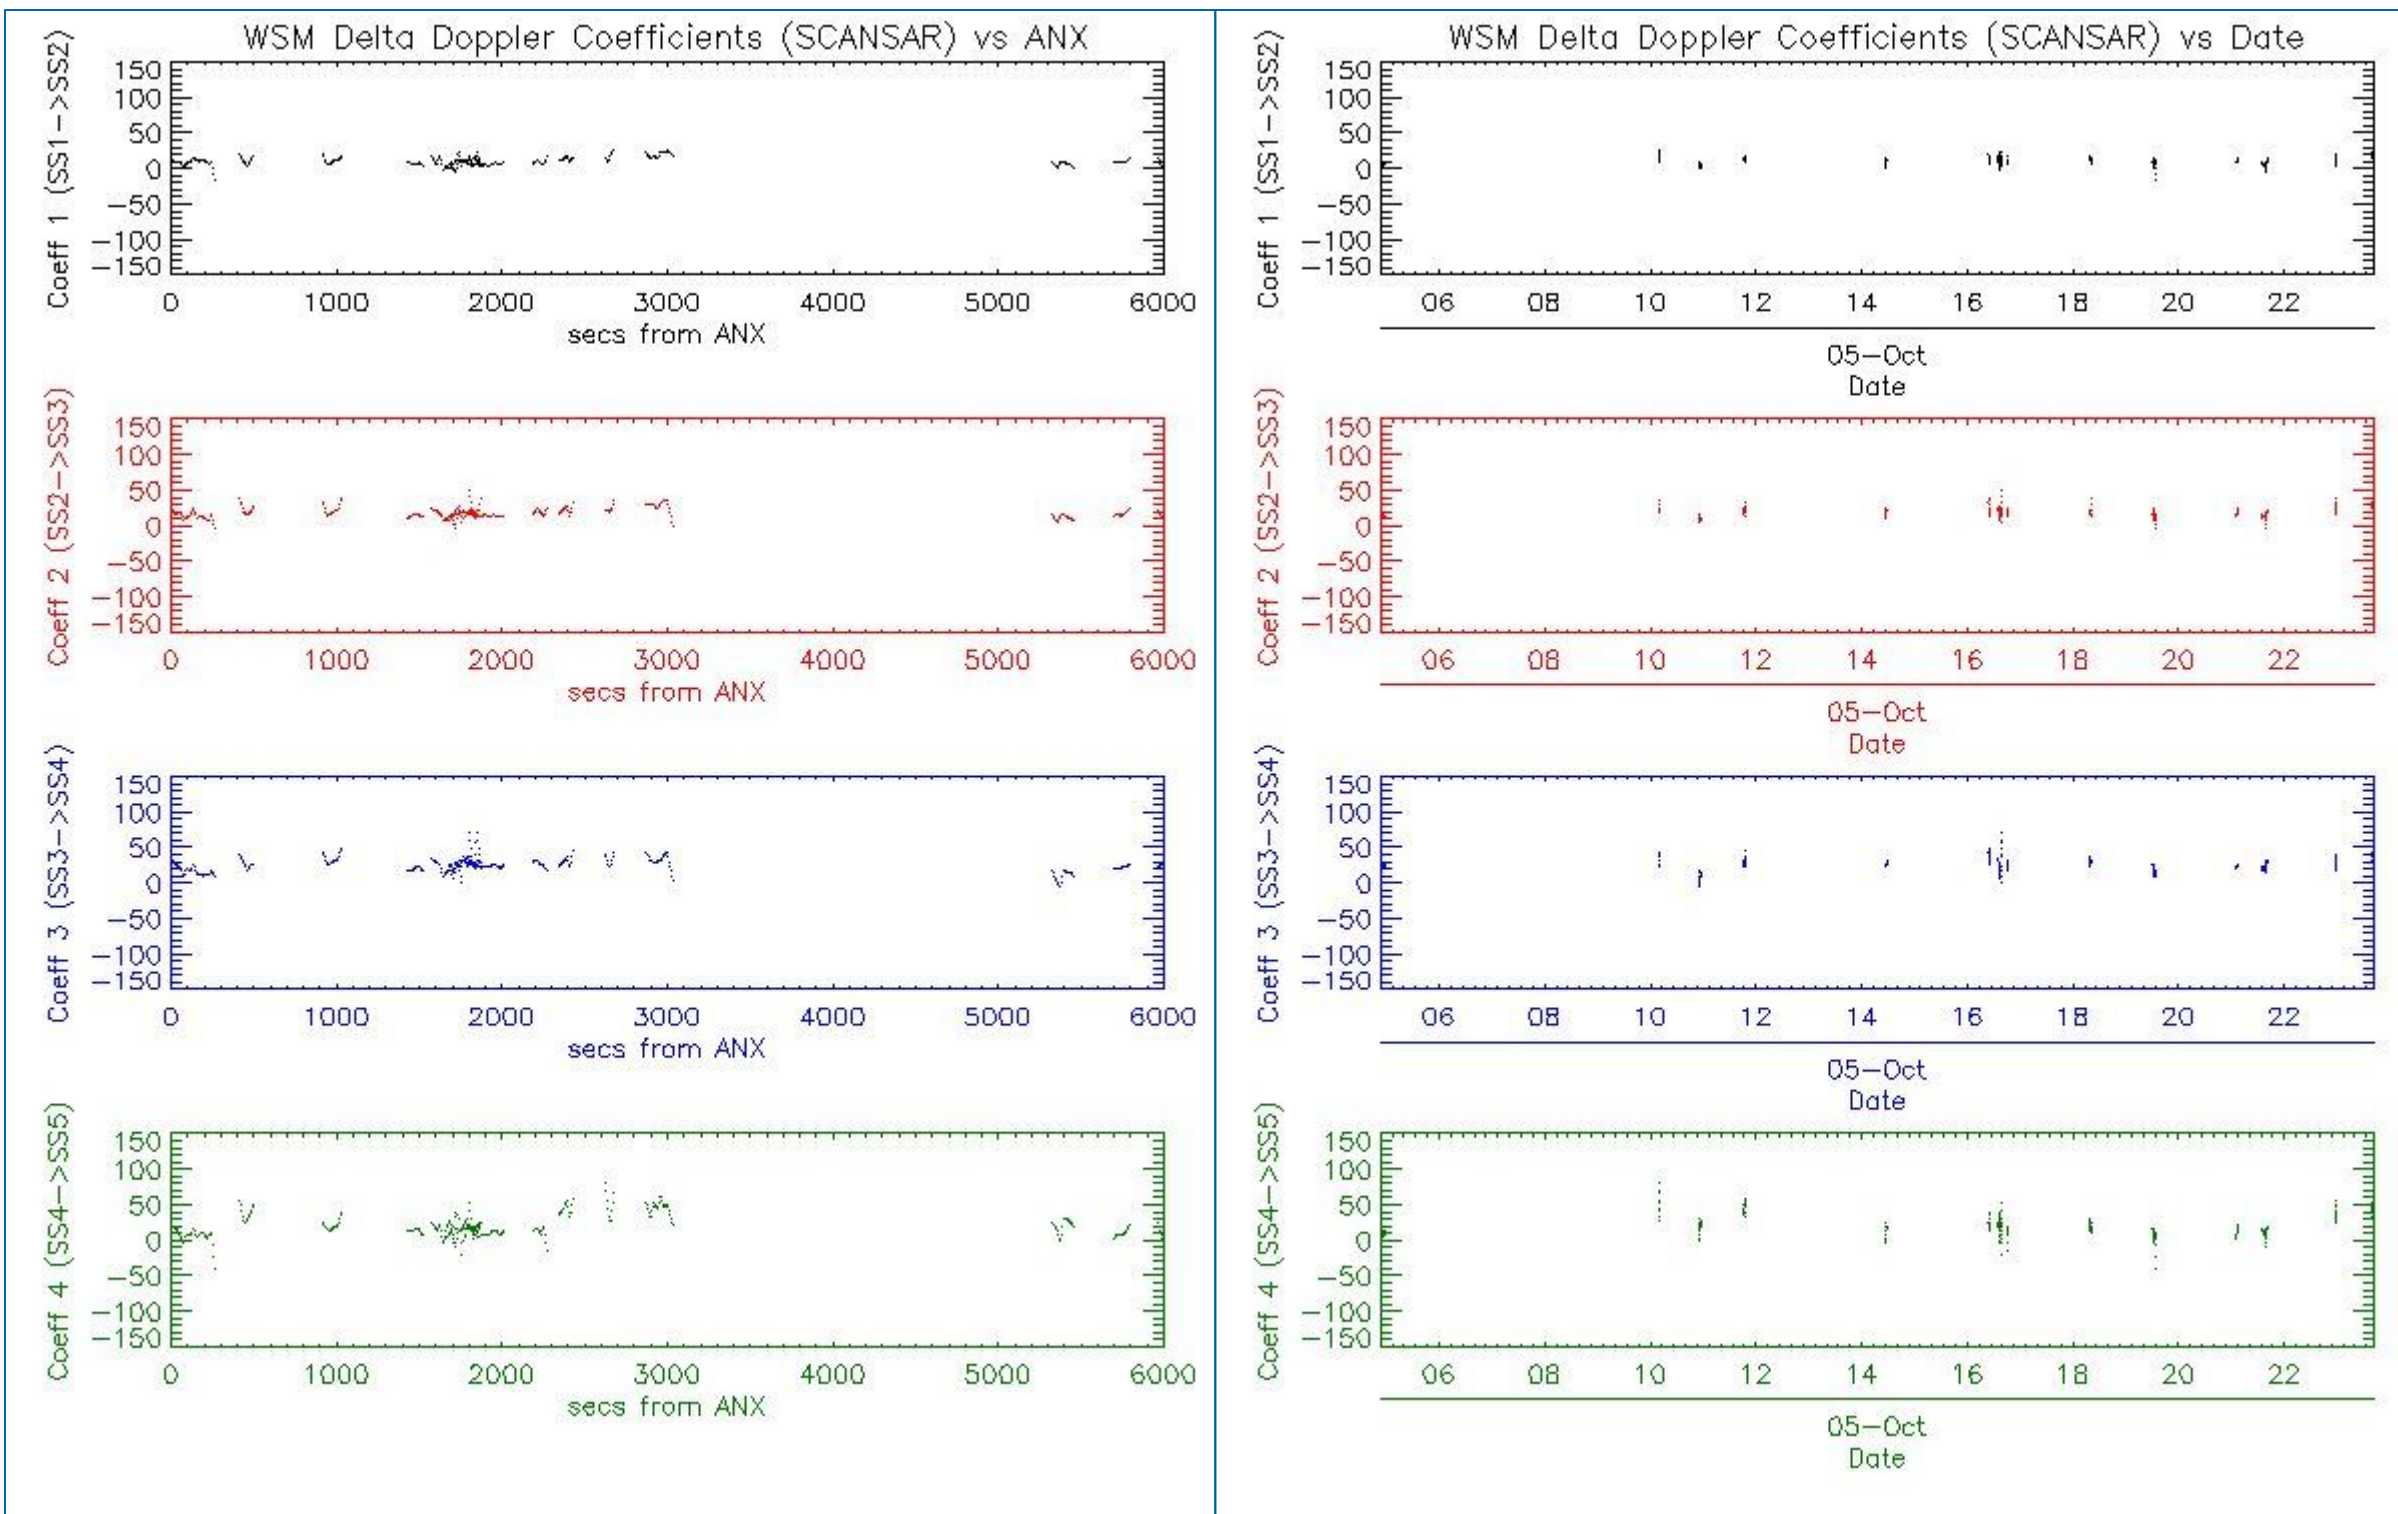



6 - CHIRP ANALYSIS

6.1 - Analysis for WSM SS1 H/H

6.1.1 - ScaleFactor

[BACK TO MENU]



--	--

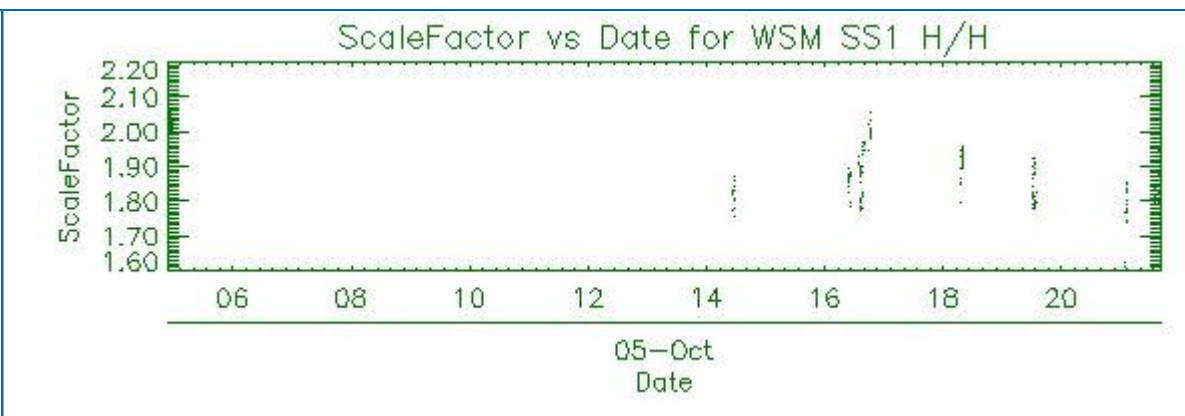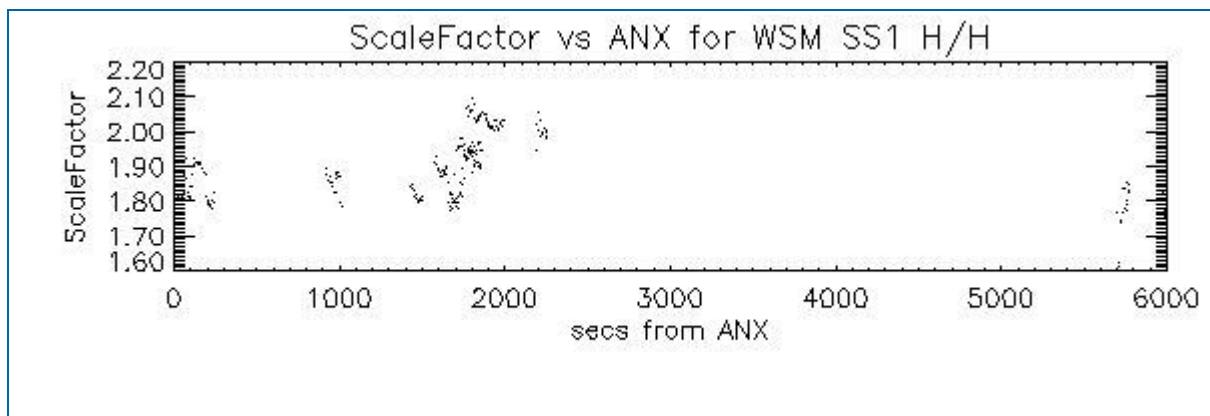

6.2 - Analysis for WSM SS1 V/V

6.2.1 - ScaleFactor

[BACK TO MENU]


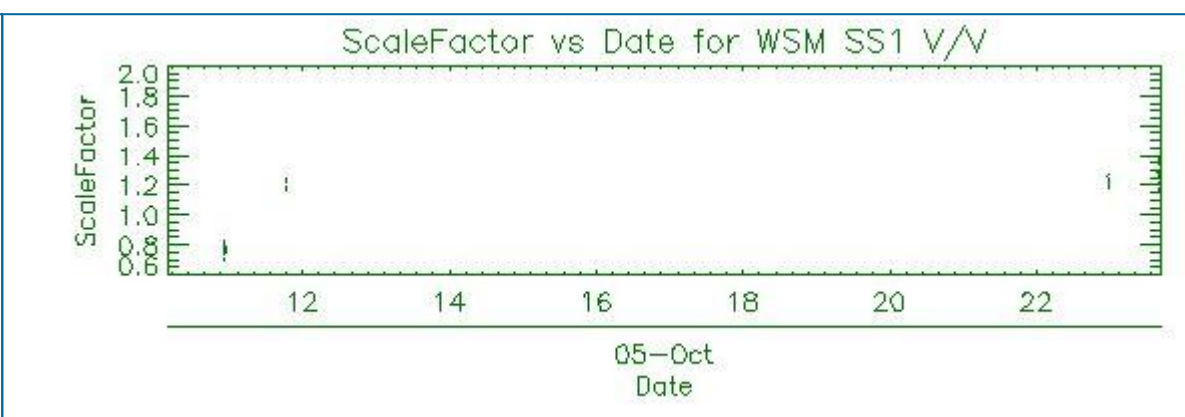
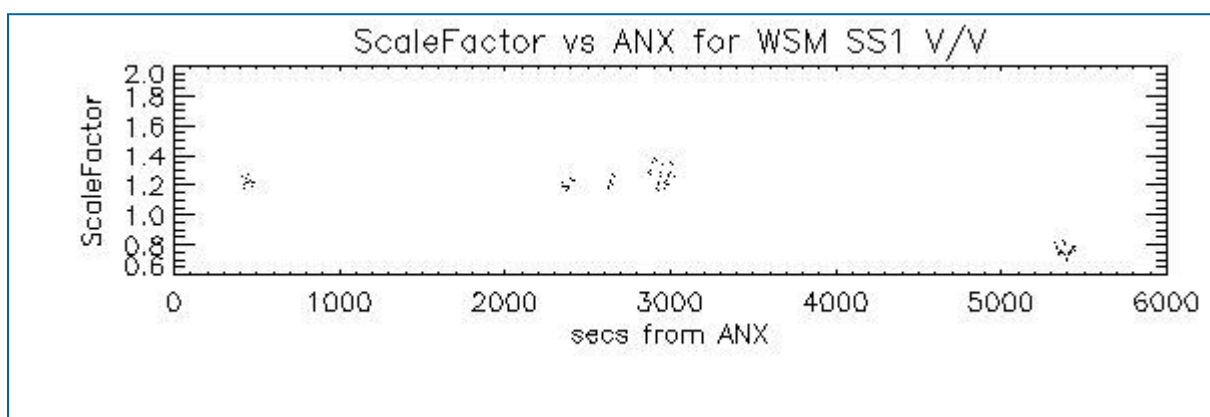


7 - RAW DATA ANALYSIS

7.1 - Analysis for WVS

[BACK TO MENU]

--	--	--	--

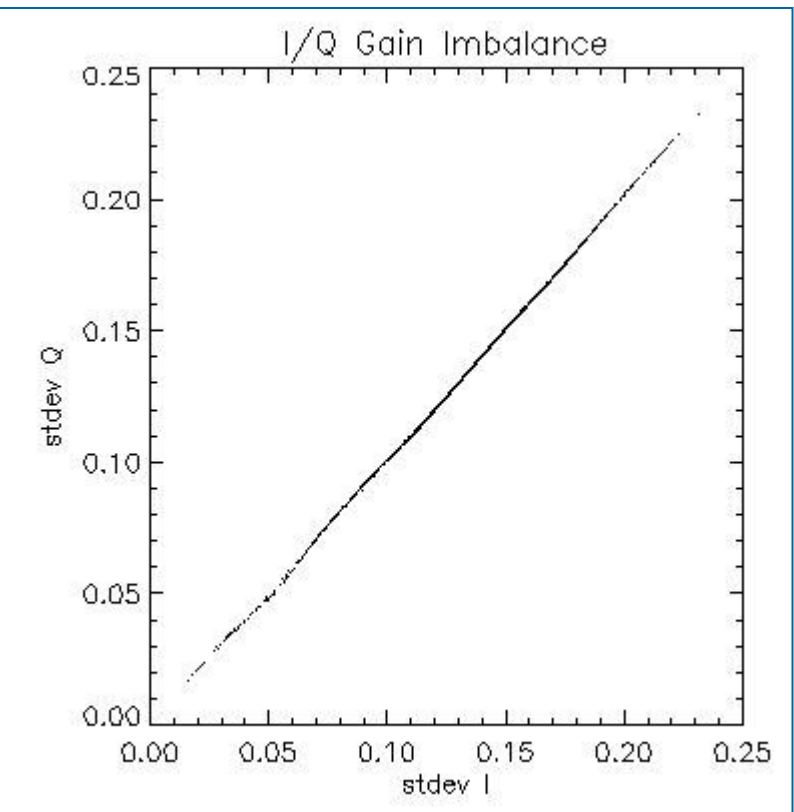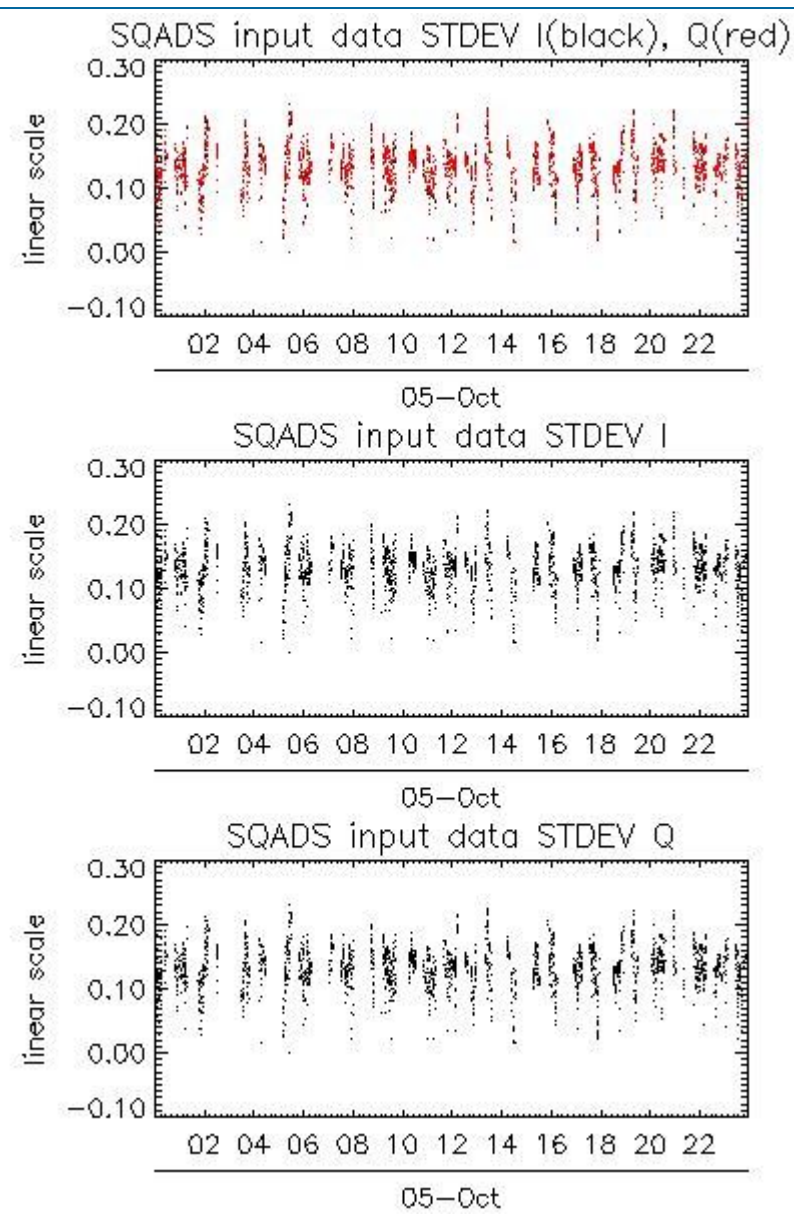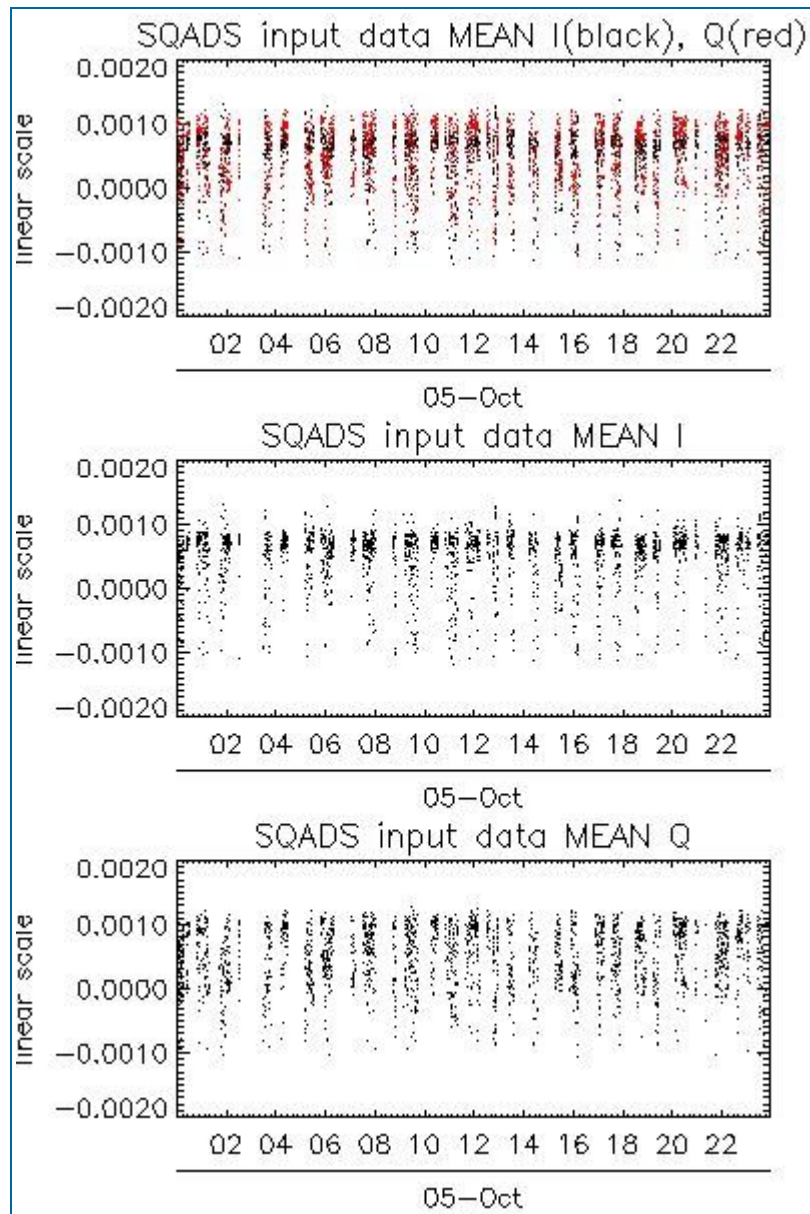


Channel	Statistics	DSS-B
MEAN I	mean	0.000501894
	stdev	2.01620e-07
MEAN Q	mean	0.000498887
	stdev	2.35085e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.132174
	stdev	0.00108636
STDEV Q	mean	0.132541
	stdev	0.00109894

7.2 - Analysis for IMM

[[BACK TO MENU](#)]

--	--	--

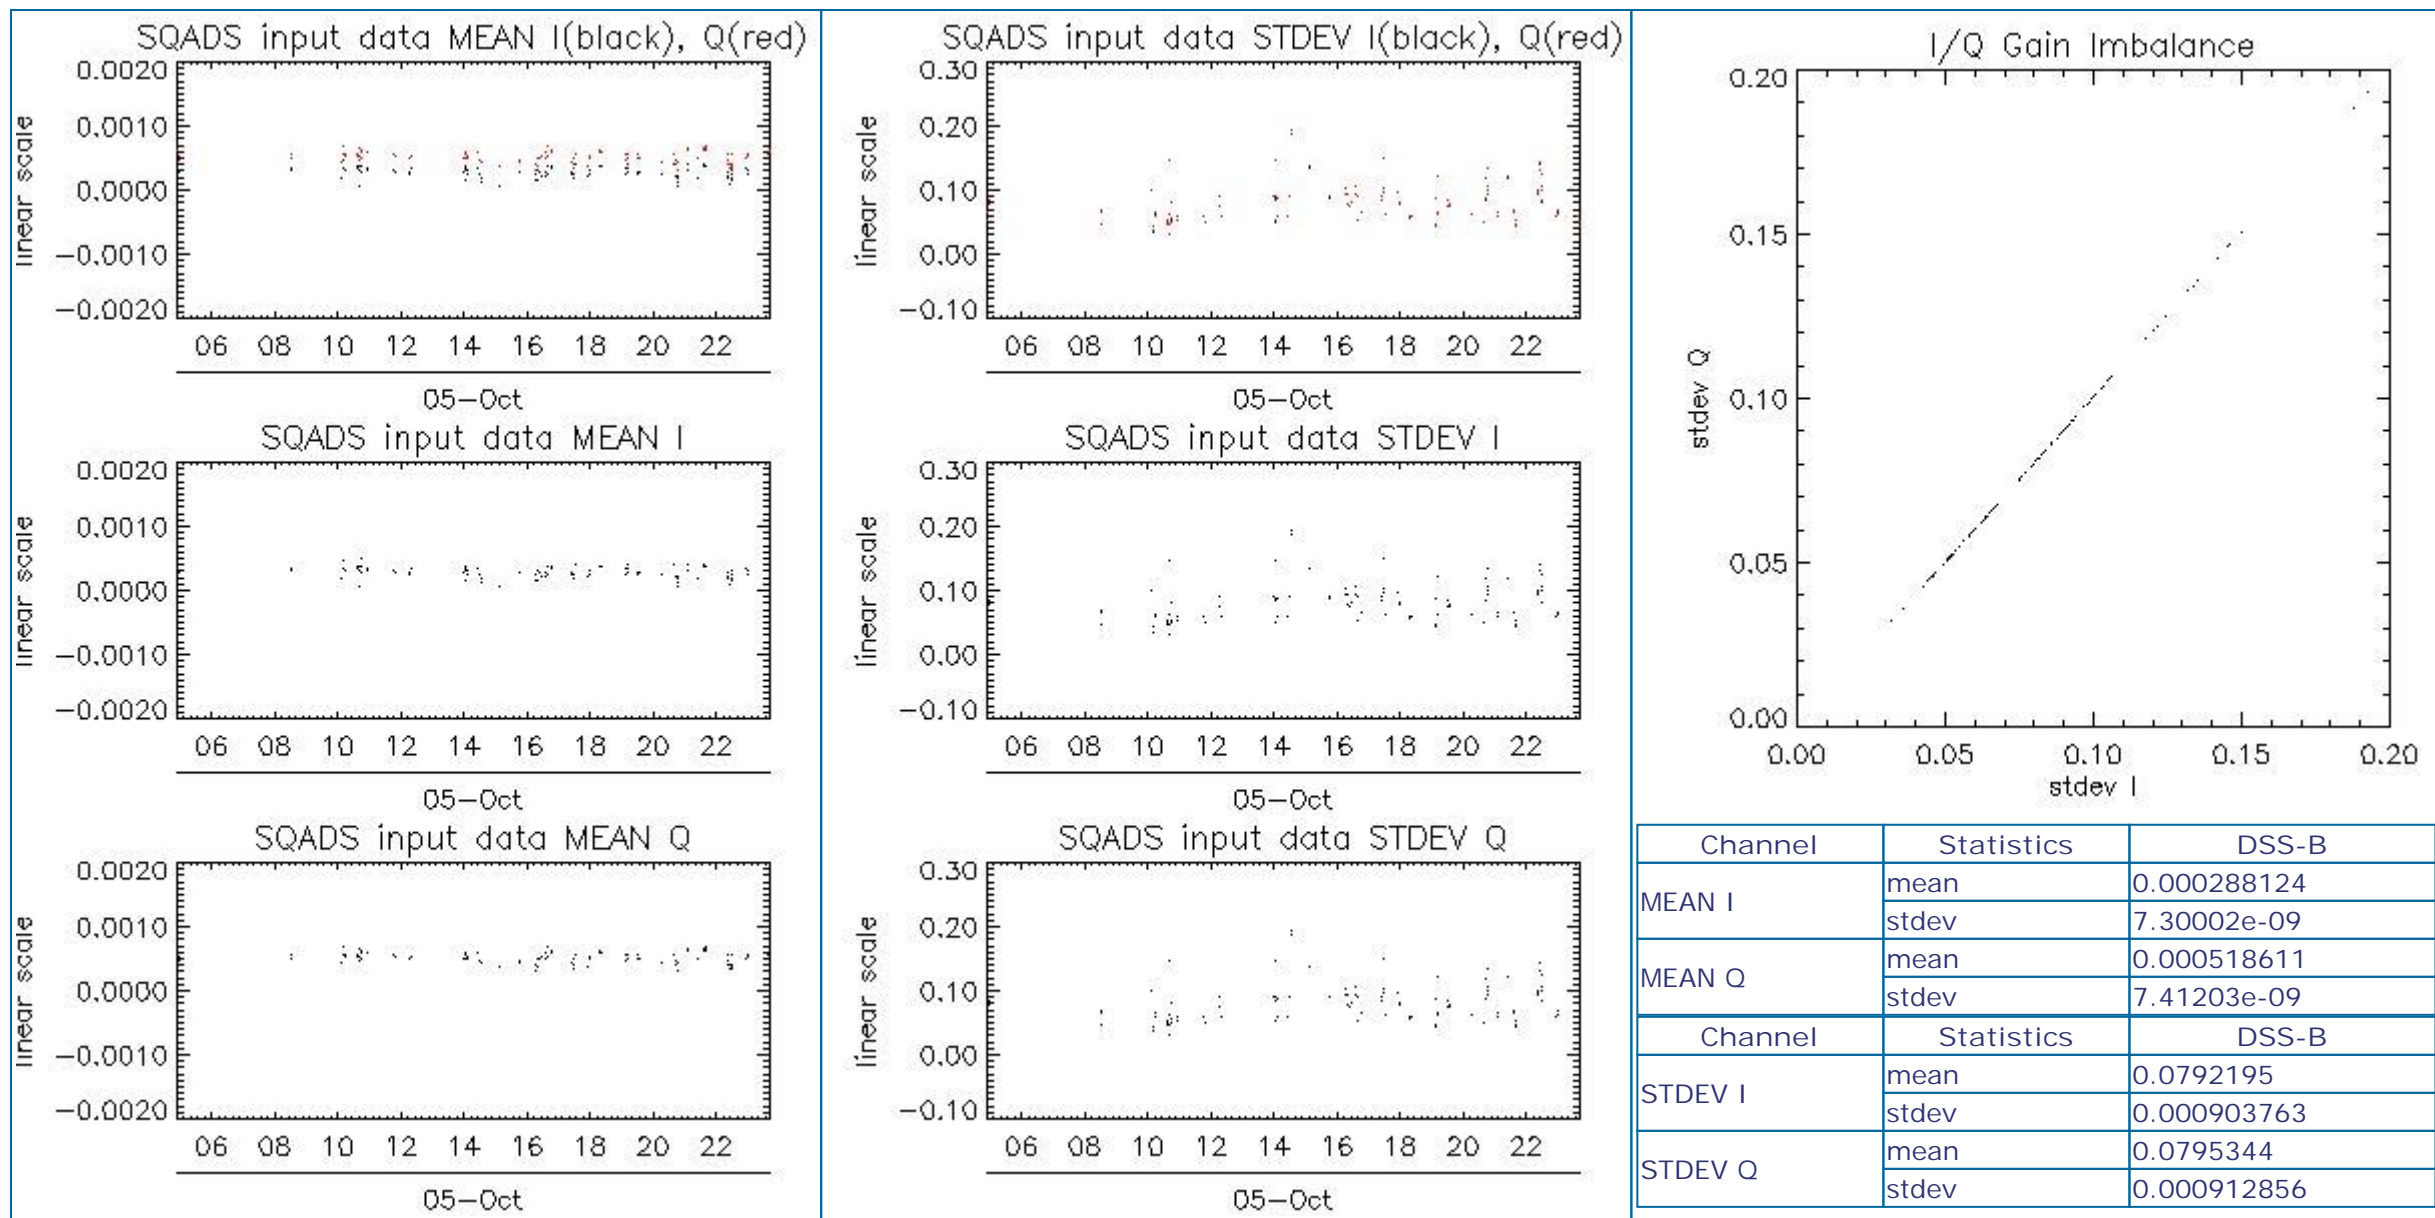



8 - TELEMETRY ANALYSIS

Processing Center	Product	Gaps	Missing lines
PDK	ASA_GM1_1PNPDK20081005_145845_000001382072_00383_34505_7181.N1	0	7
PDE	ASA_IMM_1PNPDE20081005_201432_000000582072_00386_34508_1322.N1	0	28
PDE	ASA_WSM_1PNPDE20081005_233858_000001702072_00388_34510_1651.N1	0	59

8.1 - Number of Missing lines


[BACK TO MENU]



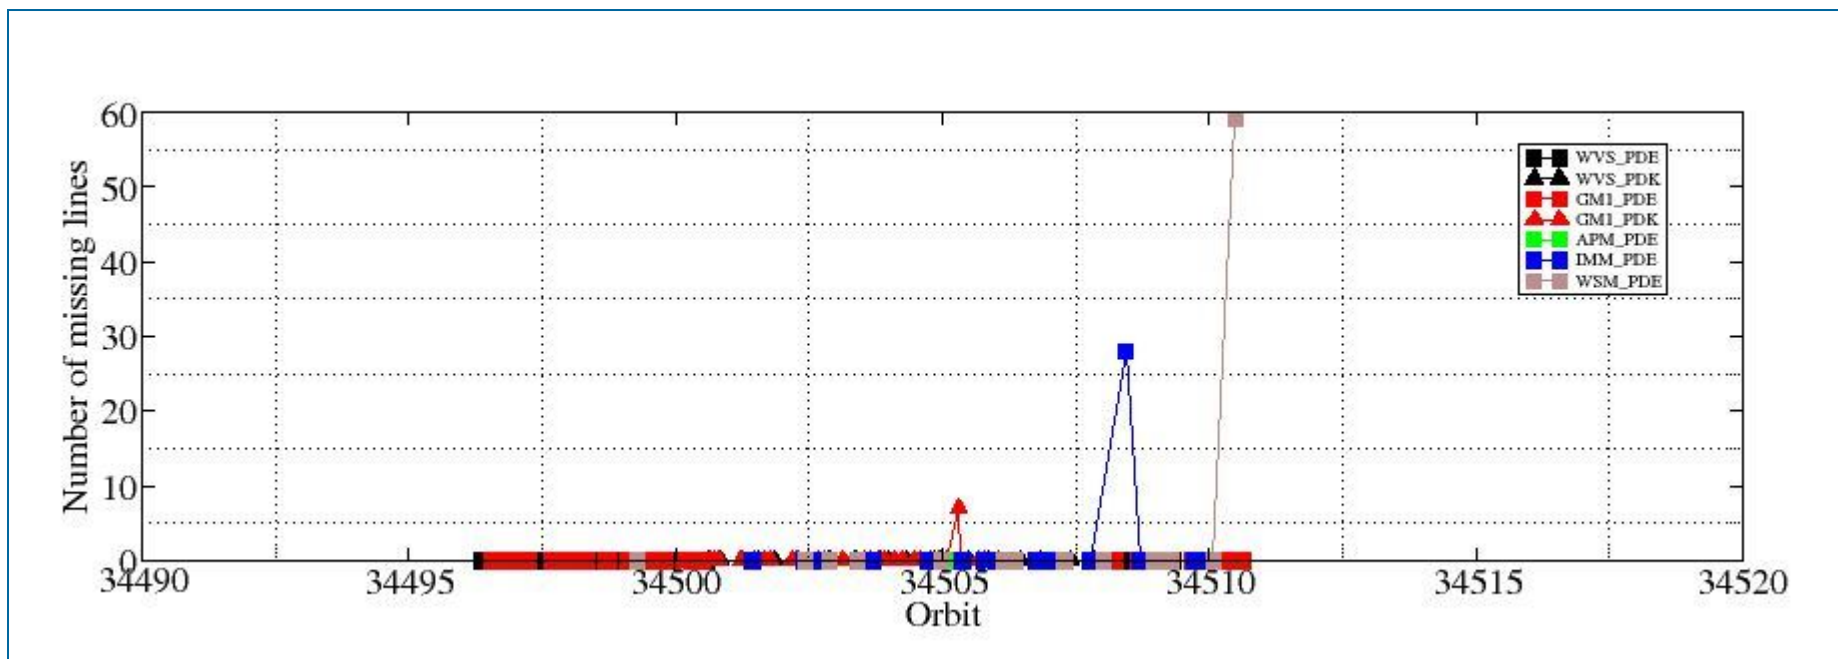

8.2 - Number of Gaps

[[BACK TO MENU](#)]

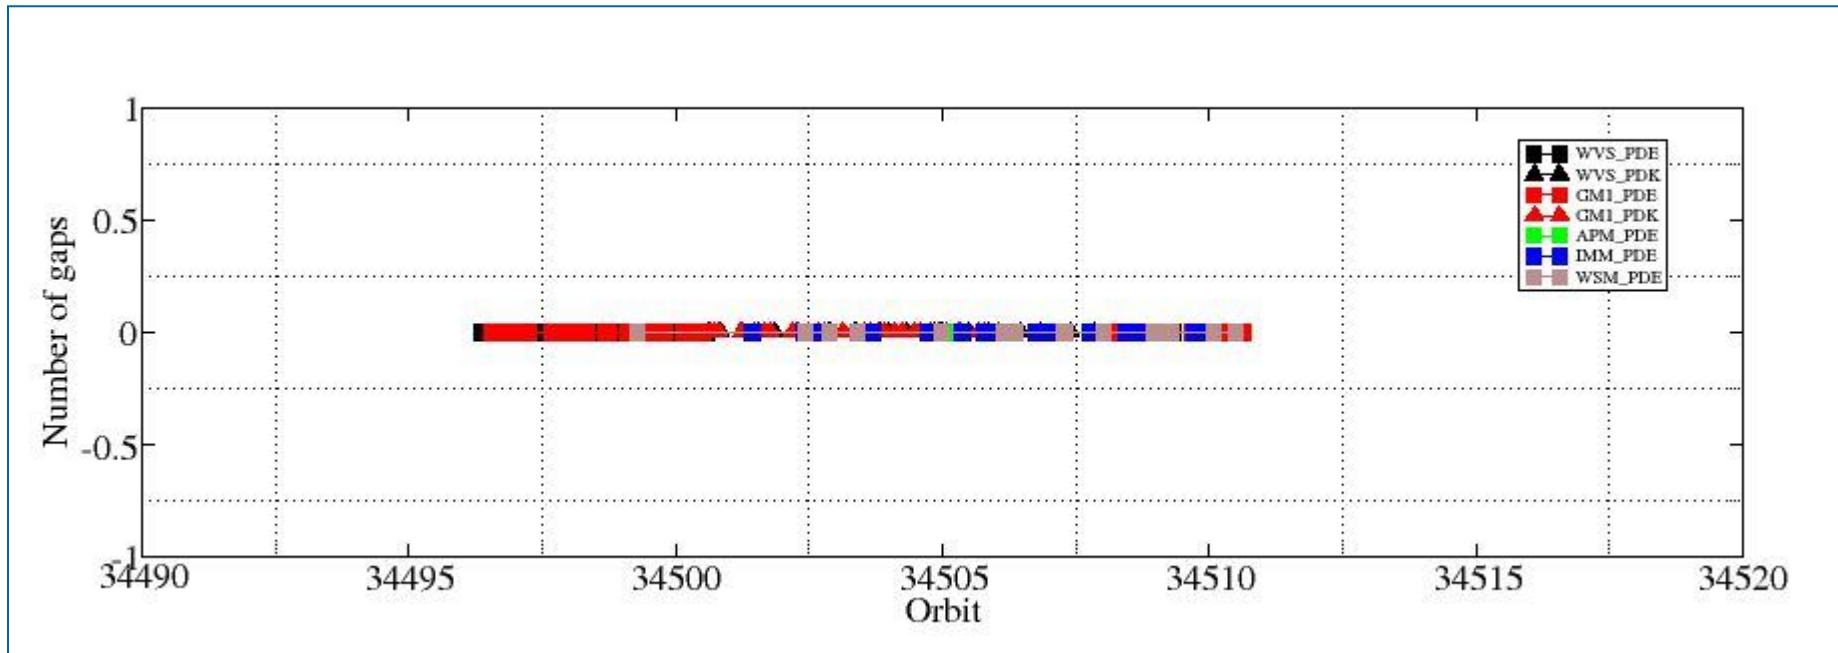

ASAR DAILY REPORT for 081005
#####

MODE: DAILY
ANALYSIS: ALL
DATE: YESTERDAY

Analysis will be performed from 2008-10-05 00:00:00 to 2008-10-05 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/081005/

DATA SUMMARY

Summary will be performed from 2008-10-05 00:00:00 to 2008-10-05 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/081005/DATA_SUMMARY

Creating directory ./RESULTS/DAILY/081005/DATA_SUMMARY...
Writing file ./RESULTS/DAILY/081005/DATA_SUMMARY/Data_summary.html...

Getting WVS products list from 2008-10-05 00:00:00 to 2008-10-05 23:59:59...
Writing file ./RESULTS/DAILY/081005/DATA_SUMMARY/List_WVS_products_used.xls...
Writing file ./RESULTS/DAILY/081005/DATA_SUMMARY/List_WVS_products_used.txt...

Getting GM1 products list from 2008-10-05 00:00:00 to 2008-10-05 23:59:59...
Writing file ./RESULTS/DAILY/081005/DATA_SUMMARY/List_GM1_products_used.xls...
Writing file ./RESULTS/DAILY/081005/DATA_SUMMARY/List_GM1_products_used.txt...

Getting APM products list from 2008-10-05 00:00:00 to 2008-10-05 23:59:59...
Writing file ./RESULTS/DAILY/081005/DATA_SUMMARY/List_APM_products_used.xls...
Writing file ./RESULTS/DAILY/081005/DATA_SUMMARY/List_APM_products_used.txt...

Getting IMM products list from 2008-10-05 00:00:00 to 2008-10-05 23:59:59...
Writing file ./RESULTS/DAILY/081005/DATA_SUMMARY/List_IMM_products_used.xls...
Writing file ./RESULTS/DAILY/081005/DATA_SUMMARY/List_IMM_products_used.txt...

Getting WSM products list from 2008-10-05 00:00:00 to 2008-10-05 23:59:59...
Writing file ./RESULTS/DAILY/081005/DATA_SUMMARY/List_WSM_products_used.xls...
Writing file ./RESULTS/DAILY/081005/DATA_SUMMARY/List_WSM_products_used.txt...

Getting MS products list from 2008-10-05 00:00:00 to 2008-10-05 23:59:59...
Writing file ./RESULTS/DAILY/081005/DATA_SUMMARY/List_MS_products_used.xls...
Writing file ./RESULTS/DAILY/081005/DATA_SUMMARY/List_MS_products_used.txt...

DATA SUMMARY completed
#####

AUXILIARY FILES ANALYSIS

Analysis will be performed from 2008-10-05 00:00:00 to 2008-10-05 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/081005/AUXILIARY

Creating directory ./RESULTS/DAILY/081005/AUXILIARY...

Looking for the IECF operational ADFs list...



Found list 20081005_030001_current_3_IECF_ADFs.txt...
Extracting ADFs...

ASA_CON_AXVIEC20080710_132557_20070204_165113_20081231_000000
ASA_INS_AXVIEC20071218_083603_20070307_060000_20081231_000000
ASA_XCH_AXVIEC20051219_162547_20020301_000000_20081231_000000
ASA_XCA_AXVIEC20080710_133546_20070204_165113_20081231_000000

Writing file ./RESULTS/DAILY/081005/AUXILIARY/ASAR_ADFs_IECF_List3.html...
Writing file ./RESULTS/DAILY/081005/AUXILIARY/Auxiliary_files_summary.html...

Analysing WVS products...

Writing file ./RESULTS/DAILY/081005/AUXILIARY/Check_ADFs_WVS.xls...
Writing file ./RESULTS/DAILY/081005/AUXILIARY/Check_ADFs_WVS.txt...

ASA_WVS_1PNPDE20081005_002304_000003002072_00374_34496_0245.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_004751_000002552072_00374_34496_0248.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_005121_000003742072_00374_34496_0380.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_010251_000007342072_00374_34496_0383.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_011715_000000602072_00375_34497_0390.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_014405_000001642072_00375_34497_0393.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_014758_000003142072_00375_34497_0396.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_015447_000008392072_00375_34497_0412.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_020832_000000152072_00375_34497_0545.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_022827_000002252072_00375_34497_0577.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_033025_000008392072_00376_34498_0584.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_034410_000001952072_00376_34498_0720.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_041041_000001202072_00376_34498_0717.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_041449_000004792072_00376_34498_0725.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_042455_000001642072_00377_34499_0732.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_051004_000009892072_00377_34499_0775.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_052618_000002102072_00377_34499_0897.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_054939_000017392072_00377_34499_0943.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_070251_000001802072_00378_34500_0931.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_200342_000006142072_00386_34508_1230.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_201536_000011842072_00386_34508_1247.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_205502_000003002072_00386_34508_1364.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_212048_000000592072_00387_34509_1367.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_214402_000019042072_00387_34509_1380.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_223538_000001652072_00387_34509_1385.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_223723_000008542072_00387_34509_1516.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_225934_000004042072_00388_34510_1521.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_232626_000007042072_00388_34510_1524.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_234148_000002242072_00388_34510_1529.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081005_235236_000002252072_00388_34510_1540.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_070536_000002852072_00378_34500_6575.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_073015_000017992072_00378_34500_6610.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_084225_000005252072_00379_34501_6660.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_091051_000019342072_00379_34501_6738.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_101549_000009442072_00380_34502_6802.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_105126_000001802072_00380_34502_6799.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_105730_000013792072_00380_34502_6809.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_114031_000002852072_00381_34503_6916.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_114733_000006592072_00381_34503_6919.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_120053_000006892072_00381_34503_6928.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_123202_000002552072_00381_34503_6931.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_124440_000008402072_00381_34503_6941.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_132111_000008542072_00382_34504_7055.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_141238_000003152072_00382_34504_7061.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_142259_000001942072_00382_34504_7058.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_142831_000002992072_00383_34505_7068.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_151547_000010642072_00383_34505_7194.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_155314_000012142072_00383_34505_7203.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081005_165411_000011992072_00384_34506_7330.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK



ASA_WVS_1PNPDK20081005_173350_000012892072_00384_34506_7340.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_WVS_1PNPDK20081005_182903_000015292072_00385_34507_7454.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_WVS_1PNPDK20081005_191426_000008392072_00385_34507_7466.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing GM1 products...

Writing file ./RESULTS/DAILY/081005/AUXILIARY/Check_ADFs_GM1.xls...

Writing file ./RESULTS/DAILY/081005/AUXILIARY/Check_ADFs_GM1.txt...

ASA_GM1_1PNPDE20081005_001753_000003082072_00374_34496_0242.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_002848_000002052072_00374_34496_0240.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_004426_000002052072_00374_34496_0250.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_005812_000002772072_00374_34496_0387.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_011903_000003022072_00375_34497_0385.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_012711_000010152072_00375_34497_0479.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_020924_000001382072_00375_34497_0551.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_021916_000000902072_00375_34497_0549.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_022533_000001692072_00375_34497_0547.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_023300_000004952072_00375_34497_0553.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_024241_000002472072_00375_34497_0555.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_025701_000004652072_00376_34498_0557.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_030535_000007432072_00376_34498_0581.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_031958_000004772072_00376_34498_0579.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_035048_000001082072_00376_34498_0722.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_035755_000007612072_00376_34498_0727.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_043303_000006102072_00377_34499_0729.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_044451_000005492072_00377_34499_0759.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_045812_000002172072_00377_34499_0734.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_050605_000002352072_00377_34499_0761.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_053036_000000842072_00377_34499_0901.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_054619_000001992072_00377_34499_0899.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_061916_000001632072_00378_34500_0903.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_062246_000005922072_00378_34500_0937.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_063840_000002052072_00378_34500_0933.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_064334_000002712072_00378_34500_0905.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_064925_000004472072_00378_34500_0935.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_065752_000002952072_00378_34500_0939.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_195559_000004592072_00386_34508_1236.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_203559_000002352072_00386_34508_1234.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_204225_000001502072_00386_34508_1232.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_204842_000002592072_00386_34508_1254.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_205144_000001932072_00386_34508_1359.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_210050_000002412072_00386_34508_1361.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_210640_000005552072_00386_34508_1373.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_213604_000001322072_00387_34509_1371.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_214108_000001692072_00387_34509_1369.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_221635_000001812072_00387_34509_1375.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_222209_000002052072_00387_34509_1377.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_223128_000002472072_00387_34509_1382.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_225217_000001992072_00388_34510_1513.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_225636_000000842072_00388_34510_1518.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_231447_000006942072_00388_34510_1526.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_234611_000002892072_00388_34510_1531.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_235104_000000902072_00388_34510_1535.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20081005_235711_000002652072_00388_34510_1533.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20081005_071112_000002292072_00378_34500_6572.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20081005_071935_000000902072_00378_34500_6570.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20081005_072535_000002772072_00378_34500_6577.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20081005_080701_000003982072_00379_34501_6584.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20081005_081226_000006342072_00379_34501_6653.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20081005_083252_000005732072_00379_34501_6657.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20081005_085148_000003682072_00379_34501_6655.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20081005_090350_000004162072_00379_34501_6662.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20081005_094348_000005312072_00380_34502_6664.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20081005_095412_000001202072_00380_34502_6740.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

```
ASA_GM1_1PNPDK20081005_095529_000003562072_00380_34502_6792.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_101343_000001262072_00380_34502_6794.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_103224_000002232072_00380_34502_6796.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_104538_000003442072_00380_34502_6804.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_112117_000006522072_00381_34503_6806.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_115913_00000962072_00381_34503_6921.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_121300_000001992072_00381_34503_6923.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_122747_000002532072_00381_34503_6925.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_123814_000003862072_00381_34503_6933.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_125919_000009182072_00382_34504_6943.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_131328_000002652072_00382_34504_7048.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_133605_000006762072_00382_34504_7050.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_134728_000007432072_00382_34504_7052.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_140614_000003802072_00382_34504_7063.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_141833_000002652072_00382_34504_7065.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_143507_000007432072_00383_34505_7075.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_145845_000001382072_00383_34505_7181.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_150219_000002052072_00383_34505_7189.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_153411_000005792072_00383_34505_7191.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_154524_000004712072_00383_34505_7196.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081005_161419_000001082072_00384_34506_7198.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

Analysing APM products...

Writing file ./RESULTS/DAILY/081005/AUXILIARY/Check_ADFs_APM.xls...

Writing file ./RESULTS/DAILY/081005/AUXILIARY/Check_ADFs_APM.txt...

```
ASA_APM_1PNPDE20081005_101131_000001122072_00380_34502_1060.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20081005_143404_00000432072_00383_34505_1122.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

Analysing IMM products...

Writing file ./RESULTS/DAILY/081005/AUXILIARY/Check_ADFs_IMM.xls...

Writing file ./RESULTS/DAILY/081005/AUXILIARY/Check_ADFs_IMM.txt...

```
ASA_IMM_1PNPDE20081005_082931_000001912072_00379_34501_1030.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_100444_00000432072_00380_34502_1049.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_103607_000003972072_00380_34502_1079.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_104313_000001352072_00380_34502_1098.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_121618_000000622072_00381_34503_1100.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_121618_000001822072_00381_34503_1116.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_121821_000000592072_00381_34503_1104.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_135950_000003732072_00382_34504_1156.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_150542_00000372072_00383_34505_1124.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_154351_000000822072_00383_34505_1162.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_154454_00000192072_00383_34505_1120.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_161605_00000372072_00384_34506_1130.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_161645_000001632072_00384_34506_1158.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_172241_000000792072_00384_34506_1192.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_172738_000002372072_00384_34506_1190.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_175555_000001822072_00385_34507_1202.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_190627_000003432072_00385_34507_1225.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_201432_000000582072_00386_34508_1322.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_203952_000001392072_00386_34508_1344.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_204452_000002192072_00386_34508_1324.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_212232_000000372072_00387_34509_1458.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_221936_000001392072_00387_34509_1496.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_222536_000003422072_00387_34509_1494.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081005_225538_00000482072_00388_34510_1476.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```



Analysing WSM products...

Writing file ./RESULTS/DAILY/081005/AUXILIARY/Check_ADFs_WSM.xls...
Writing file ./RESULTS/DAILY/081005/AUXILIARY/Check_ADFs_WSM.txt...

ASA_WSM_1PNPDE20081005_045405_000002452072_00377_34499_1032.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081005_101003_000000612072_00380_34502_1051.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081005_105507_000001352072_00380_34502_1111.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081005_114604_000000912072_00381_34503_1106.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081005_142701_000000922072_00382_34504_1160.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081005_162402_000001212072_00384_34506_1164.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081005_163503_000001832072_00384_34506_1204.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081005_163846_000000732072_00384_34506_1174.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081005_164514_000000912072_00384_34506_1200.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081005_181805_000001532072_00385_34507_1227.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081005_193026_000002382072_00386_34508_1351.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081005_210455_000001032072_00386_34508_1349.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081005_213423_000000972072_00387_34509_1498.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081005_213818_000001642072_00387_34509_1509.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081005_225804_000000922072_00388_34510_1511.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081005_233858_000001702072_00388_34510_1651.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

AUXILIARY FILES ANALYSIS completed
#####

MODULE STEPPING ANALYSIS
#####
Analysis will be performed from 2008-10-05 00:00:00 to 2008-10-05 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/081005/MODULE_STEPPING

Creating directory ./RESULTS/DAILY/081005/MODULE_STEPPING...
Creating directory ./RESULTS/DAILY/081005/MODULE_STEPPING/FIRST_REFERENCE...
Creating directory ./RESULTS/DAILY/081005/MODULE_STEPPING/SECOND_REFERENCE...
Creating directory ./RESULTS/DAILY/081005/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...
Deleting old files...

Creating images comparing with second reference...

Exporting results to the directory ../../RESULTS/DAILY/081005/MODULE_STEPPING/SECOND_REFERENCE...

Polarization: H
Reference product: ASA_MS_0PNPDK20050922_062651_00000152041_00034_18625_0041.N1
Test product: ASA_MS_0PNPDK20081004_060340_00000162072_00363_34485_0651.N1
H
H
../../RESULTS/DAILY/081005/MODULE_STEPPING/SECOND_REFERENCE/TGH_20081004_060340-20050922_062651.png
../../RESULTS/DAILY/081005/MODULE_STEPPING/SECOND_REFERENCE/TPH_20081004_060340-20050922_062651.png
../../RESULTS/DAILY/081005/MODULE_STEPPING/SECOND_REFERENCE/RGH_20081004_060340-20050922_062651.png
../../RESULTS/DAILY/081005/MODULE_STEPPING/SECOND_REFERENCE/RPH_20081004_060340-20050922_062651.png

Polarization: V
Reference product: ASA_MS_0PNPDK20050923_055514_00000152041_00048_18639_0042.N1
Test product: ASA_MS_0PNPDE20081005_053203_00000162072_00377_34499_0340.N1
V
V
../../RESULTS/DAILY/081005/MODULE_STEPPING/SECOND_REFERENCE/TGV_20081005_053203-20050923_055514.png
../../RESULTS/DAILY/081005/MODULE_STEPPING/SECOND_REFERENCE/TPV_20081005_053203-20050923_055514.png
../../RESULTS/DAILY/081005/MODULE_STEPPING/SECOND_REFERENCE/RGV_20081005_053203-20050923_055514.png
../../RESULTS/DAILY/081005/MODULE_STEPPING/SECOND_REFERENCE/RPV_20081005_053203-20050923_055514.png

Creating images comparing with previous product reference...

Exporting results to the directory ../../RESULTS/DAILY/081005/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Polarization: H

Reference product: ASA_MS_0PNPDK20081002_070654_000000162072_00335_34457_0649.N1

Test product: ASA_MS_0PNPDK20081004_060340_000000162072_00363_34485_0651.N1

H
H

../../RESULTS/DAILY/081005/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGH_20081004_060340-20081002_070654.png
../../RESULTS/DAILY/081005/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPH_20081004_060340-20081002_070654.png
../../RESULTS/DAILY/081005/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGH_20081004_060340-20081002_070654.png
../../RESULTS/DAILY/081005/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPH_20081004_060340-20081002_070654.png

Polarization: V

Reference product: ASA_MS_0PNPDK20081003_063517_000000162072_00349_34471_0650.N1

Test product: ASA_MS_0PNPDE20081005_053203_000000162072_00377_34499_0340.N1

V
V

../../RESULTS/DAILY/081005/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGV_20081005_053203-20081003_063517.png
../../RESULTS/DAILY/081005/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPV_20081005_053203-20081003_063517.png
../../RESULTS/DAILY/081005/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGV_20081005_053203-20081003_063517.png
../../RESULTS/DAILY/081005/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPV_20081005_053203-20081003_063517.png

MODULE_STEPPING ANALYSIS completed

#####

CALIBRATION PULSES ANALYSIS

#####

Creating directory ./RESULTS/DAILY/081005/CALIBRATION_PULSES...

ALL ROWS Analysis will be performed from 2008-10-05 00:00:00 to 2008-10-05 23:59:59

Analysing products WVS IS2 V/V

Writing image ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Calibration_pulses_all_rows_WVS_IS2_VV.png...

Analysing products GM1 SS3 H/H

Writing image ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Calibration_pulses_all_rows_GM1_SS3_HH.png...

TEMPORAL EVOLUTION Analysis will be performed from 2008-10-05 00:00:00 to 2008-10-05 23:59:59

Analysing products WVS IS2 V/V

Getting calibration pulses data for WVS IS2 V/V from 2008-10-05 00:00:00 to 2008-10-05 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/081005/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2008-10-05_1.dat...

Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_1.png...

Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2008-10-05 00:00:00 to 2008-10-05 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/081005/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2008-10-05_2.dat...

Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_2.png...

Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2008-10-05 00:00:00 to 2008-10-05 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/081005/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2008-10-05_3.dat...

Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_3.png...

Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2008-10-05 00:00:00 to 2008-10-05 23:59:59. Rows: 4/8/12/16/20/24/28/32
Writing file ./RESULTS/DAILY/081005/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2008-10-05_4.dat...
Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_4.png...
Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_4.png...

Analysing products GM1 SS3 H/H
Getting calibration pulses data for GM1 SS3 H/H from 2008-10-05 00:00:00 to 2008-10-05 23:59:59. Rows: 1/5/9/13/17/21/25/29
Writing file ./RESULTS/DAILY/081005/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2008-10-05_1.dat...
Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_1.png...
Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_1.png...

Getting calibration pulses data for GM1 SS3 H/H from 2008-10-05 00:00:00 to 2008-10-05 23:59:59. Rows: 2/6/10/14/18/22/26/30
Writing file ./RESULTS/DAILY/081005/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2008-10-05_2.dat...
Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_2.png...
Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2008-10-05 00:00:00 to 2008-10-05 23:59:59. Rows: 3/7/11/15/19/23/27/31
Writing file ./RESULTS/DAILY/081005/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2008-10-05_3.dat...
Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_3.png...
Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2008-10-05 00:00:00 to 2008-10-05 23:59:59. Rows: 4/8/12/16/20/24/28/32
Writing file ./RESULTS/DAILY/081005/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2008-10-05_4.dat...
Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_4.png...
Writing ../../RESULTS/DAILY/081005//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_4.png...

CALIBRATION PULSES ANALYSIS completed
#####

DOPPLER ANALYSIS

Creating directory ./RESULTS/DAILY/081005/DOPPLER...

DOPPLER ANX Analysis will be performed from 2008-10-05 00:00:00 to 2008-10-05 23:59:59

Analysing products WVS IS2 V/V
Getting doppler data for WVS IS2 V/V from 2008-10-05 00:00:00 to 2008-10-05 23:59:59...
Writing file ./RESULTS/DAILY/081005/DOPPLER/Doppler_data_WVS_IS2_VV_2008-10-05.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/081005/DOPPLER/DOPPLER_ANX_WVS_IS2_VV.png...

Analysing products GM1 SS1 H/H
Getting doppler data for GM1 SS1 H/H from 2008-10-05 00:00:00 to 2008-10-05 23:59:59...
Writing file ./RESULTS/DAILY/081005/DOPPLER/Doppler_data_GM1_SS1_HH_2008-10-05.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/081005/DOPPLER/DOPPLER_ANX_GM1_SS1_HH.png...

DOPPLER JUMPS Analysis will be performed on WSM products from 2008-10-05 00:00:00 to 2008-10-05 23:59:59

Analysing by default products WSM
Getting doppler jumps data for WSM from 2008-10-05 00:00:00 to 2008-10-05 23:59:59...



Writing file ./RESULTS/DAILY/081005/DOPPLER/Doppler_Jumps_data_WSM_2008-10-05.dat...
Running IDL program...
Writing file ../RESULTS/DAILY/081005/DOPPLER/DOPPLER_JUMPS_ANX_WSM.png...
Writing file ../RESULTS/DAILY/081005/DOPPLER/DOPPLER_JUMPS_Date_WSM.png...

DOPPLER MAP Analysis will be performed from 2008-10-05 00:00:00 to 2008-10-05 23:59:59

Analysing products WVS IS2 V/V
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -28.149294 Hz
Writing file ../RESULTS/DAILY/081005//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_desc.jpg...
Writing file ../RESULTS/DAILY/081005//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_desc.jpg...

Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -27.465049 Hz
Writing file ../RESULTS/DAILY/081005//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_asc.jpg...
Writing file ../RESULTS/DAILY/081005//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_asc.jpg...

Analysing products GM1 SS1 H/H
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -17.724382 Hz
Writing file ../RESULTS/DAILY/081005//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_desc.jpg...
Writing file ../RESULTS/DAILY/081005//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_desc.jpg...

Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -27.055421 Hz
Writing file ../RESULTS/DAILY/081005//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_asc.jpg...
Writing file ../RESULTS/DAILY/081005//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_asc.jpg...

DOPPLER ANALYSIS completed
#####

CHIRP ANALYSIS

Creating directory ./RESULTS/DAILY/081005/CHIRP...

CHIRP Analysis will be performed from 2008-10-05 00:00:00 to 2008-10-05 23:59:59

Analysing products WSM SS1 H/H

```
*****
Getting ScaleFactor data for WSM SS1 H/H from 2008-10-05 00:00:00 to 2008-10-05 23:59:59...
Writing file ./RESULTS/DAILY/081005/CHIRP/ScaleFactor_data_WSM_SS1_HH_2008-10-05.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/081005/CHIRP/ScaleFactor_ANX_WSM_SS1_HH.png...
Writing file ../../RESULTS/DAILY/081005/CHIRP/ScaleFactor_DATE_WSM_SS1_HH.png...
```

```
Analysing products WSM SS1 V/V
*****
Getting ScaleFactor data for WSM SS1 V/V from 2008-10-05 00:00:00 to 2008-10-05 23:59:59...
Writing file ./RESULTS/DAILY/081005/CHIRP/ScaleFactor_data_WSM_SS1_VV_2008-10-05.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/081005/CHIRP/ScaleFactor_ANX_WSM_SS1_VV.png...
Writing file ../../RESULTS/DAILY/081005/CHIRP/ScaleFactor_DATE_WSM_SS1_VV.png...
```

```
CHIRP ANALYSIS completed
#####
```

```
RAW DATA ANALYSIS
#####
Analysis will be performed from 2008-10-05 00:00:00 to 2008-10-05 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/081005/RAW_DATA
```

```
Creating directory ./RESULTS/DAILY/081005/RAW_DATA...
```

```
*****
Getting raw data for WVS from 2008-10-05 00:00:00 to 2008-10-05 23:59:59...
Writing file ./RESULTS/DAILY/081005/RAW_DATA/Raw_data_WVS_2008-10-05.dat...
Running IDL program to create graphs...
```

```
Creating image ../../RESULTS/DAILY/081005/RAW_DATA/Raw_data_WVS_input_mean.png...
Creating image ../../RESULTS/DAILY/081005/RAW_DATA/Raw_data_WVS_input_stdev.png...
Creating image ../../RESULTS/DAILY/081005/RAW_DATA/Raw_data_WVS_gain_imbalance.png...
```

```
*****
Getting raw data for IMM from 2008-10-05 00:00:00 to 2008-10-05 23:59:59...
Writing file ./RESULTS/DAILY/081005/RAW_DATA/Raw_data_IMM_2008-10-05.dat...
Running IDL program to create graphs...
```

```
Creating image ../../RESULTS/DAILY/081005/RAW_DATA/Raw_data_IMM_input_mean.png...
Creating image ../../RESULTS/DAILY/081005/RAW_DATA/Raw_data_IMM_input_stdev.png...
Creating image ../../RESULTS/DAILY/081005/RAW_DATA/Raw_data_IMM_gain_imbalance.png...
```

```
RAW DATA ANALYSIS completed
#####
```

```
TELEMETRY ANALYSIS
#####
Analysis will be performed from 2008-10-05 00:00:00 to 2008-10-05 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/081005/TELEMETRY
```

```
Creating directory ./RESULTS/DAILY/081005/TELEMETRY...
```

```
Looking for gaps and missing lines in WVS products...
*****
Checking 31 products from PDE...
Checking 22 products from PDK...
```

```
Looking for gaps and missing lines in GM1 products...
*****
Checking 46 products from PDE...
```

Checking 31 products from PDK...
Found product...ASA_GM1_1PNPDK20081005_145845_000001382072_00383_34505_7181.N1 / 0 gaps / 7 missing lines

Looking for gaps and missing lines in APM products...

Checking 2 products from PDE...
No products from PDK...

Looking for gaps and missing lines in IMM products...

Checking 24 products from PDE...
Found product...ASA_IMM_1PNPDE20081005_201432_00000582072_00386_34508_1322.N1 / 0 gaps / 28 missing lines
No products from PDK...

Looking for gaps and missing lines in WSM products...

Checking 16 products from PDE...
Found product...ASA_WSM_1PNPDE20081005_233858_000001702072_00388_34510_1651.N1 / 0 gaps / 59 missing lines
No products from PDK...

Creating graph of missing lines and gaps...

Creating image: ./RESULTS/DAILY/081005/TELEMETRY/TELEMETRY_Missing_lines.png...
Creating image: ./RESULTS/DAILY/081005/TELEMETRY/TELEMETRY_Gaps.png...

TELEMETRY ANALYSIS completed

#####

BROWSE PRODUCTS ANALYSIS

#####

Analysis will be performed on 2008-10-05

Scanning directory /nas3/ENVISAT/ASAR//ASA_GM_BP...
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_GM_BP/JPG/20081005/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_195559_000004592072_00386_34508_1237.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_203559_000002352072_00386_34508_1235.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_204225_000001502072_00386_34508_1233.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_204842_000002592072_00386_34508_1255.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_205144_000001932072_00386_34508_1360.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_210050_000002412072_00386_34508_1362.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_210640_000005552072_00386_34508_1374.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_213604_000001322072_00387_34509_1372.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_214108_000001692072_00387_34509_1370.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_221635_000001812072_00387_34509_1376.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_222209_000002052072_00387_34509_1378.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_223128_000002472072_00387_34509_1383.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_225217_000001992072_00388_34510_1514.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_225636_000000842072_00388_34510_1519.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_231447_000006942072_00388_34510_1527.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_234611_000002892072_00388_34510_1532.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_235104_000000902072_00388_34510_1536.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081005_235711_000002652072_00388_34510_1534.N1 ...

ANALYSIS COMPLETED: 18 GM browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_AP_BP...
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_AP_BP/JPG/20081005/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_AP_BP/ASA_AP_BPZPDE20081005_101131_000001122072_00380_34502_1061.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_AP_BP/ASA_AP_BPZPDE20081005_143404_000000432072_00383_34505_1123.N1 ...

ANALYSIS COMPLETED: 2 AP browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_IM_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_IM_BP/JPG/20081005/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_100444_000000432072_00380_34502_1050.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_103607_000003972072_00380_34502_1080.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_104313_000001352072_00380_34502_1099.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_121618_000000622072_00381_34503_1101.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_121618_000001822072_00381_34503_1117.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_121821_000000592072_00381_34503_1105.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_135950_000003732072_00382_34504_1157.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_150542_000000372072_00383_34505_1125.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_154351_000000822072_00383_34505_1163.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_154454_000000192072_00383_34505_1121.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_161605_000000372072_00384_34506_1131.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_161645_000001632072_00384_34506_1159.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_172241_000000792072_00384_34506_1193.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_172738_000002372072_00384_34506_1191.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_175555_000001822072_00385_34507_1203.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_190627_000003432072_00385_34507_1226.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_201432_000000582072_00386_34508_1323.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_203952_000001392072_00386_34508_1345.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_204452_000002192072_00386_34508_1325.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_212232_000000372072_00387_34509_1459.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_221936_000001392072_00387_34509_1497.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_222536_000003422072_00387_34509_1495.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081005_225538_000000482072_00388_34510_1477.N1 ...

ANALYSIS COMPLETED: 23 IM browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_WS_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_WS_BP/JPG/20081005/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081005_101003_000000612072_00380_34502_1052.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081005_105507_000001352072_00380_34502_1112.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081005_114604_000000912072_00381_34503_1107.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081005_142701_000000922072_00382_34504_1161.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081005_162402_000001212072_00384_34506_1165.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081005_163503_000001832072_00384_34506_1205.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081005_163846_000000732072_00384_34506_1175.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081005_164514_000000912072_00384_34506_1201.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081005_181805_000001532072_00385_34507_1228.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081005_193026_000002382072_00386_34508_1352.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081005_210455_000001032072_00386_34508_1350.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081005_213423_000000972072_00387_34509_1499.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081005_213818_000001642072_00387_34509_1510.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081005_225804_000000922072_00388_34510_1512.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081005_233858_000001702072_00388_34510_1652.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDK20081005_194751_000002992072_00386_34508_7570.N1 ...

ANALYSIS COMPLETED: 16 WS browse products to see...

BROWSE PRODUCTS ANALYSIS completed

#####

HTML REPORT generation

#####

Building file ./RESULTS/DAILY/081005/asarReport.html...
Building DATA SUMMARY section...
Building AUXILIARY FILES ANALYSIS section...
Building MODULE STEPPING ANALYSIS section...
Building CALIBRATION PULSES ANALYSIS section...
Building DOPPLER ANALYSIS section...
Building CHIRP ANALYSIS section...
Building RAW DATA ANALYSIS section...
Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed
#####



ASAR Daily Report



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20081005_101131_000001122072_00380_34502_1060.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20081005_143404_000000432072_00383_34505_1122.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20081005_001753_000003082072_00374_34496_0242.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_002848_000002052072_00374_34496_0240.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_004426_000002052072_00374_34496_0250.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_005812_000002772072_00374_34496_0387.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_011903_000003022072_00375_34497_0385.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_012711_000010152072_00375_34497_0479.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_020924_000001382072_00375_34497_0551.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_021916_000000902072_00375_34497_0549.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_022533_000001692072_00375_34497_0547.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_023300_000004952072_00375_34497_0553.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_024241_000002472072_00375_34497_0555.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_025701_000004652072_00376_34498_0557.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_030535_000007432072_00376_34498_0581.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_031958_000004772072_00376_34498_0579.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_035048_000001082072_00376_34498_0722.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_035755_000007612072_00376_34498_0727.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_043303_000006102072_00377_34499_0729.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_044451_000005492072_00377_34499_0759.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_045812_000002172072_00377_34499_0734.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_050605_000002352072_00377_34499_0761.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_053036_000000842072_00377_34499_0901.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_054619_000001992072_00377_34499_0899.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_061916_000001632072_00378_34500_0903.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_062246_000005922072_00378_34500_0937.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_063840_000002052072_00378_34500_0933.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_064334_000002712072_00378_34500_0905.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_064925_000004472072_00378_34500_0935.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_065752_000002952072_00378_34500_0939.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_195559_000004592072_00386_34508_1236.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_203559_000002352072_00386_34508_1234.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_204225_000001502072_00386_34508_1232.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_204842_000002592072_00386_34508_1254.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_205144_000001932072_00386_34508_1359.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_210050_000002412072_00386_34508_1361.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_210640_000005552072_00386_34508_1373.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_213604_000001322072_00387_34509_1371.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_214108_000001692072_00387_34509_1369.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_221635_000001812072_00387_34509_1375.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_222209_000002052072_00387_34509_1377.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_223128_000002472072_00387_34509_1382.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_225217_000001992072_00388_34510_1513.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_225636_000000842072_00388_34510_1518.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_231447_000006942072_00388_34510_1526.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_234611_000002892072_00388_34510_1531.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_235104_000000902072_00388_34510_1535.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081005_235711_000002652072_00388_34510_1533.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_071112_000002292072_00378_34500_6572.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_071935_000000902072_00378_34500_6570.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_072535_000002772072_00378_34500_6577.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_080701_000003982072_00379_34501_6584.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_081226_000006342072_00379_34501_6653.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_083252_000005732072_00379_34501_6657.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_085148_000003682072_00379_34501_6655.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_090350_000004162072_00379_34501_6662.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_094348_000005312072_00380_34502_6664.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_095412_000001202072_00380_34502_6740.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_095529_000003562072_00380_34502_6792.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_101343_000001262072_00380_34502_6794.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_103224_000002232072_00380_34502_6796.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_104538_000003442072_00380_34502_6804.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_112117_000006522072_00381_34503_6806.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_115913_000000962072_00381_34503_6921.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_121300_000001992072_00381_34503_6923.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_122747_000002532072_00381_34503_6925.N1					OK	OK	OK	OK

ASA_GM1_1PNPDK20081005_123814_000003862072_00381_34503_6933.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_125919_000009182072_00382_34504_6943.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_131328_000002652072_00382_34504_7048.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_133605_000006762072_00382_34504_7050.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_134728_000007432072_00382_34504_7052.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_140614_000003802072_00382_34504_7063.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_141833_000002652072_00382_34504_7065.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_143507_000007432072_00383_34505_7075.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_145845_000001382072_00383_34505_7181.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_150219_000002052072_00383_34505_7189.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_153411_000005792072_00383_34505_7191.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_154524_000004712072_00383_34505_7196.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081005_161419_000001082072_00384_34506_7198.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_IMM_1PNPDE20081005_082931_000001912072_00379_34501_1030.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_100444_000000432072_00380_34502_1049.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_103607_000003972072_00380_34502_1079.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_104313_000001352072_00380_34502_1098.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_121618_000000622072_00381_34503_1100.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_121618_000001822072_00381_34503_1116.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_121821_000000592072_00381_34503_1104.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_135950_000003732072_00382_34504_1156.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_150542_000000372072_00383_34505_1124.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_154351_000000822072_00383_34505_1162.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_154454_000000192072_00383_34505_1120.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_161605_000000372072_00384_34506_1130.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_161645_000001632072_00384_34506_1158.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_172241_000000792072_00384_34506_1192.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_172738_000002372072_00384_34506_1190.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_175555_000001822072_00385_34507_1202.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_190627_000003432072_00385_34507_1225.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_201432_000000582072_00386_34508_1322.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_203952_000001392072_00386_34508_1344.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_204452_000002192072_00386_34508_1324.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_212232_000000372072_00387_34509_1458.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_221936_000001392072_00387_34509_1496.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_222536_000003422072_00387_34509_1494.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20081005_225538_000000482072_00388_34510_1476.N1	OK	OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_WSM_1PNPDE20081005_045405_000002452072_00377_34499_1032.N1		OK	OK	OK
ASA_WSM_1PNPDE20081005_101003_000000612072_00380_34502_1051.N1		OK	OK	OK
ASA_WSM_1PNPDE20081005_105507_000001352072_00380_34502_1111.N1		OK	OK	OK
ASA_WSM_1PNPDE20081005_114604_000000912072_00381_34503_1106.N1		OK	OK	OK
ASA_WSM_1PNPDE20081005_142701_000000922072_00382_34504_1160.N1		OK	OK	OK
ASA_WSM_1PNPDE20081005_162402_000001212072_00384_34506_1164.N1		OK	OK	OK
ASA_WSM_1PNPDE20081005_163503_000001832072_00384_34506_1204.N1		OK	OK	OK
ASA_WSM_1PNPDE20081005_163846_000000732072_00384_34506_1174.N1		OK	OK	OK
ASA_WSM_1PNPDE20081005_164514_000000912072_00384_34506_1200.N1		OK	OK	OK
ASA_WSM_1PNPDE20081005_181805_000001532072_00385_34507_1227.N1		OK	OK	OK
ASA_WSM_1PNPDE20081005_193026_000002382072_00386_34508_1351.N1		OK	OK	OK
ASA_WSM_1PNPDE20081005_210455_000001032072_00386_34508_1349.N1		OK	OK	OK
ASA_WSM_1PNPDE20081005_213423_000000972072_00387_34509_1498.N1		OK	OK	OK
ASA_WSM_1PNPDE20081005_213818_000001642072_00387_34509_1509.N1		OK	OK	OK
ASA_WSM_1PNPDE20081005_225804_000000922072_00388_34510_1511.N1		OK	OK	OK
ASA_WSM_1PNPDE20081005_233858_000001702072_00388_34510_1651.N1		OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20081005_002304_000003002072_00374_34496_0245.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_004751_000002552072_00374_34496_0248.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_005121_000003742072_00374_34496_0380.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_010251_000007342072_00374_34496_0383.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_011715_00000602072_00375_34497_0390.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_014405_000001642072_00375_34497_0393.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_014758_000003142072_00375_34497_0396.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_015447_000008392072_00375_34497_0412.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_020832_000000152072_00375_34497_0545.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_022827_000002252072_00375_34497_0577.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_033025_000008392072_00376_34498_0584.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_034410_000001952072_00376_34498_0720.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_041041_000001202072_00376_34498_0717.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_041449_000004792072_00376_34498_0725.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_042455_000001642072_00377_34499_0732.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_051004_000009892072_00377_34499_0775.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_052618_000002102072_00377_34499_0897.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_054939_000017392072_00377_34499_0943.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_070251_000001802072_00378_34500_0931.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_200342_000006142072_00386_34508_1230.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_201536_000011842072_00386_34508_1247.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_205502_000003002072_00386_34508_1364.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_212048_000000592072_00387_34509_1367.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_214402_000019042072_00387_34509_1380.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_223538_000001652072_00387_34509_1385.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_223723_000008542072_00387_34509_1516.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_225934_000004042072_00388_34510_1521.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_232626_000007042072_00388_34510_1524.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_234148_000002242072_00388_34510_1529.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081005_235236_000002252072_00388_34510_1540.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_070536_000002852072_00378_34500_6575.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_073015_000017992072_00378_34500_6610.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_084225_000005252072_00379_34501_6660.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_091051_000019342072_00379_34501_6738.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_101549_000009442072_00380_34502_6802.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_105126_000001802072_00380_34502_6799.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_105730_000013792072_00380_34502_6809.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_114031_000002852072_00381_34503_6916.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_114733_000006592072_00381_34503_6919.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_120053_000006892072_00381_34503_6928.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_123202_000002552072_00381_34503_6931.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_124440_000008402072_00381_34503_6941.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_132111_000008542072_00382_34504_7055.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_141238_000003152072_00382_34504_7061.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_142259_000001942072_00382_34504_7058.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_142831_000002992072_00383_34505_7068.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_151547_000010642072_00383_34505_7194.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_155314_000012142072_00383_34505_7203.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_165411_000011992072_00384_34506_7330.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_173350_000012892072_00384_34506_7340.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_182903_000015292072_00385_34507_7454.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081005_191426_000008392072_00385_34507_7466.N1					OK	OK	OK	OK


Calibration pulses for GM1 SS3 H/H

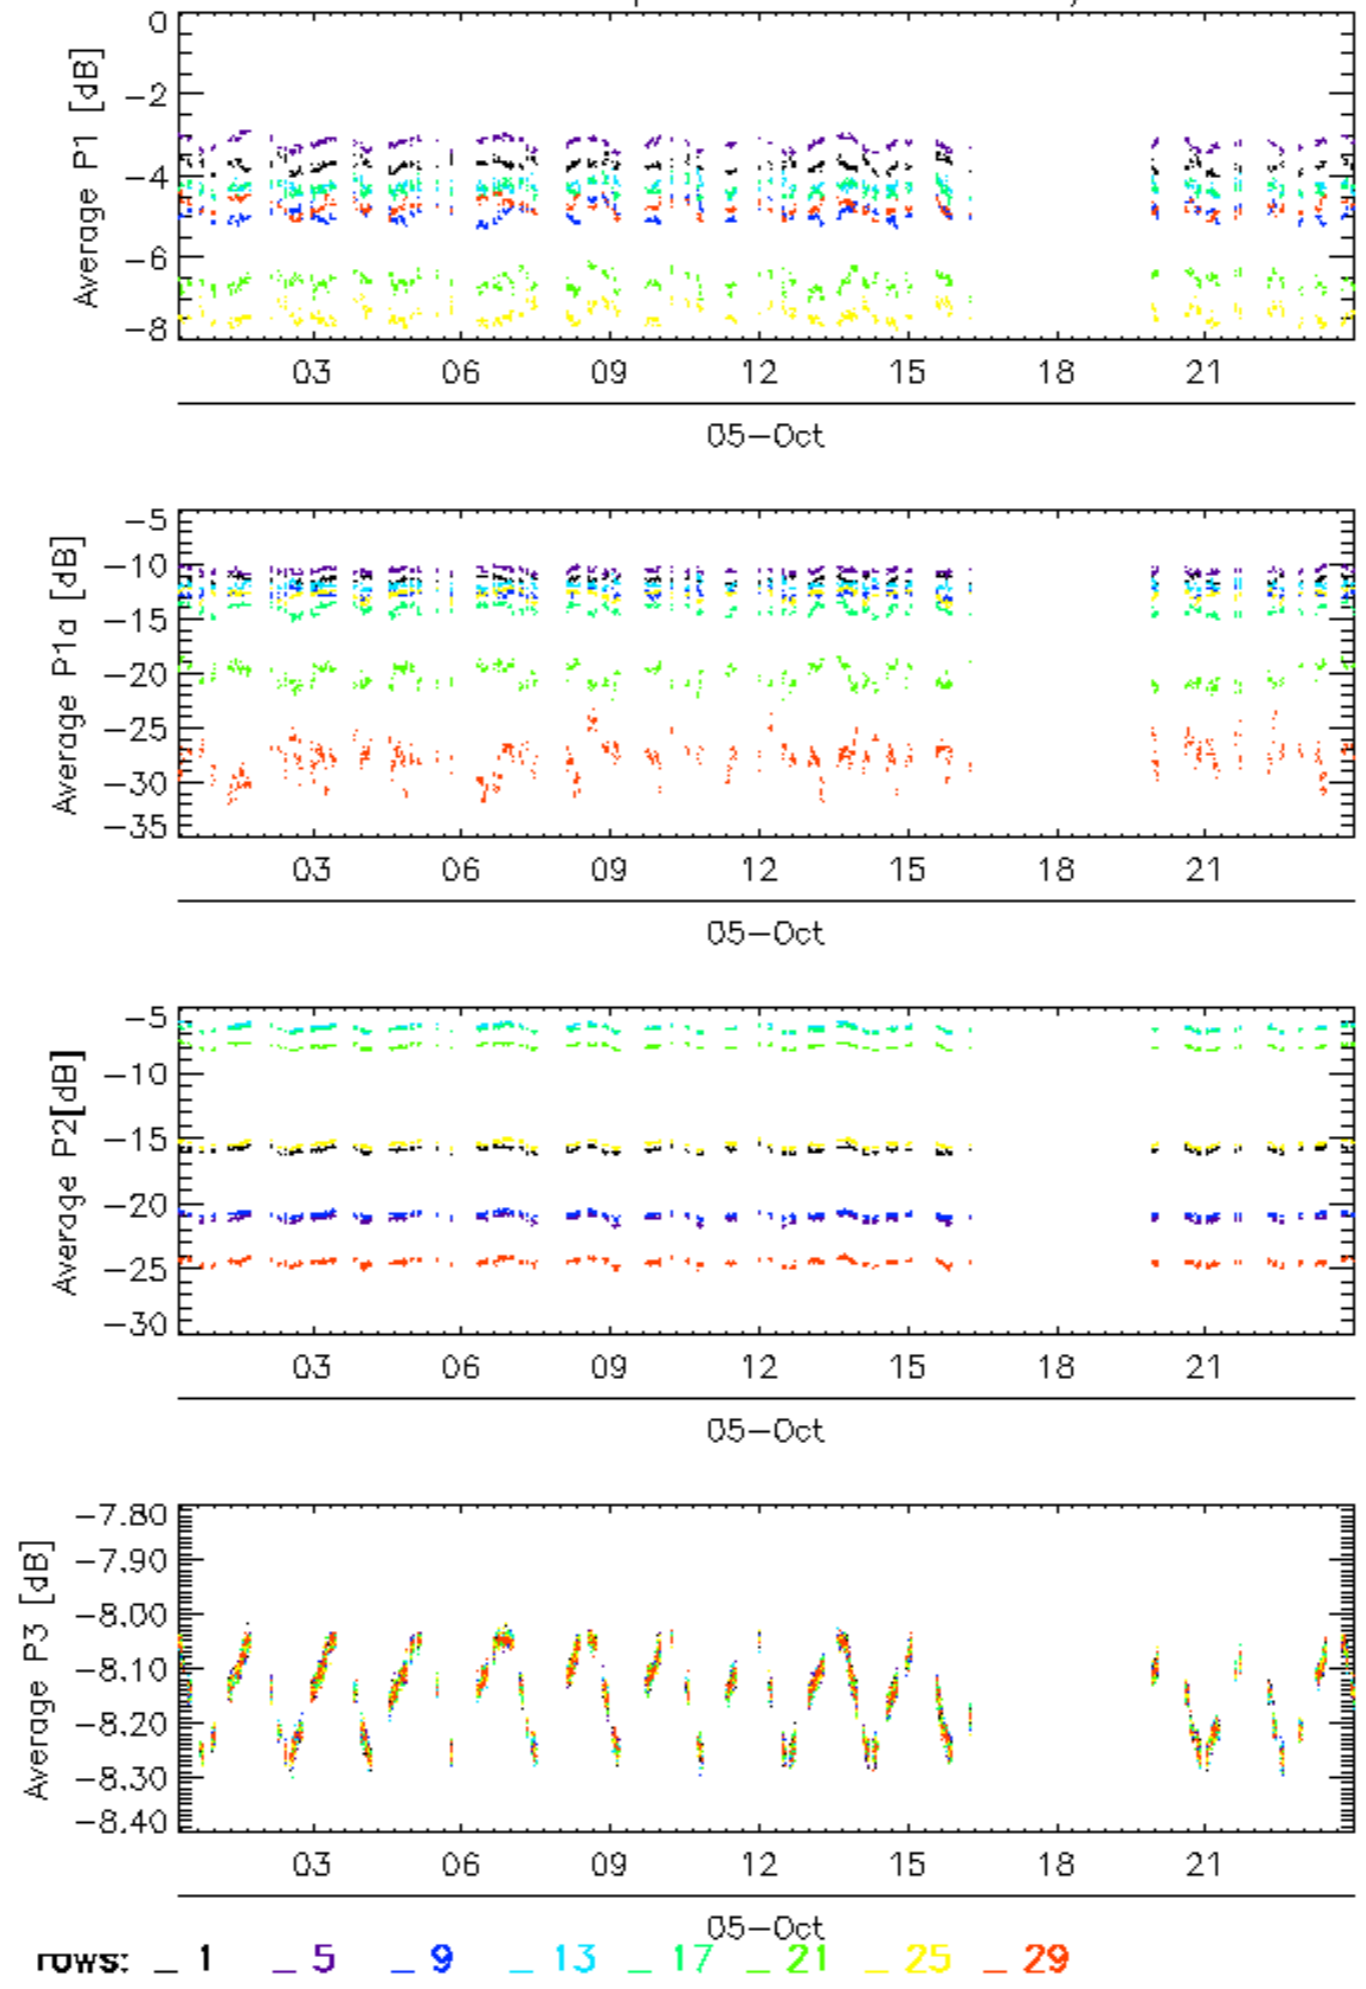


Calibration pulses for GM1 SS3 H/H

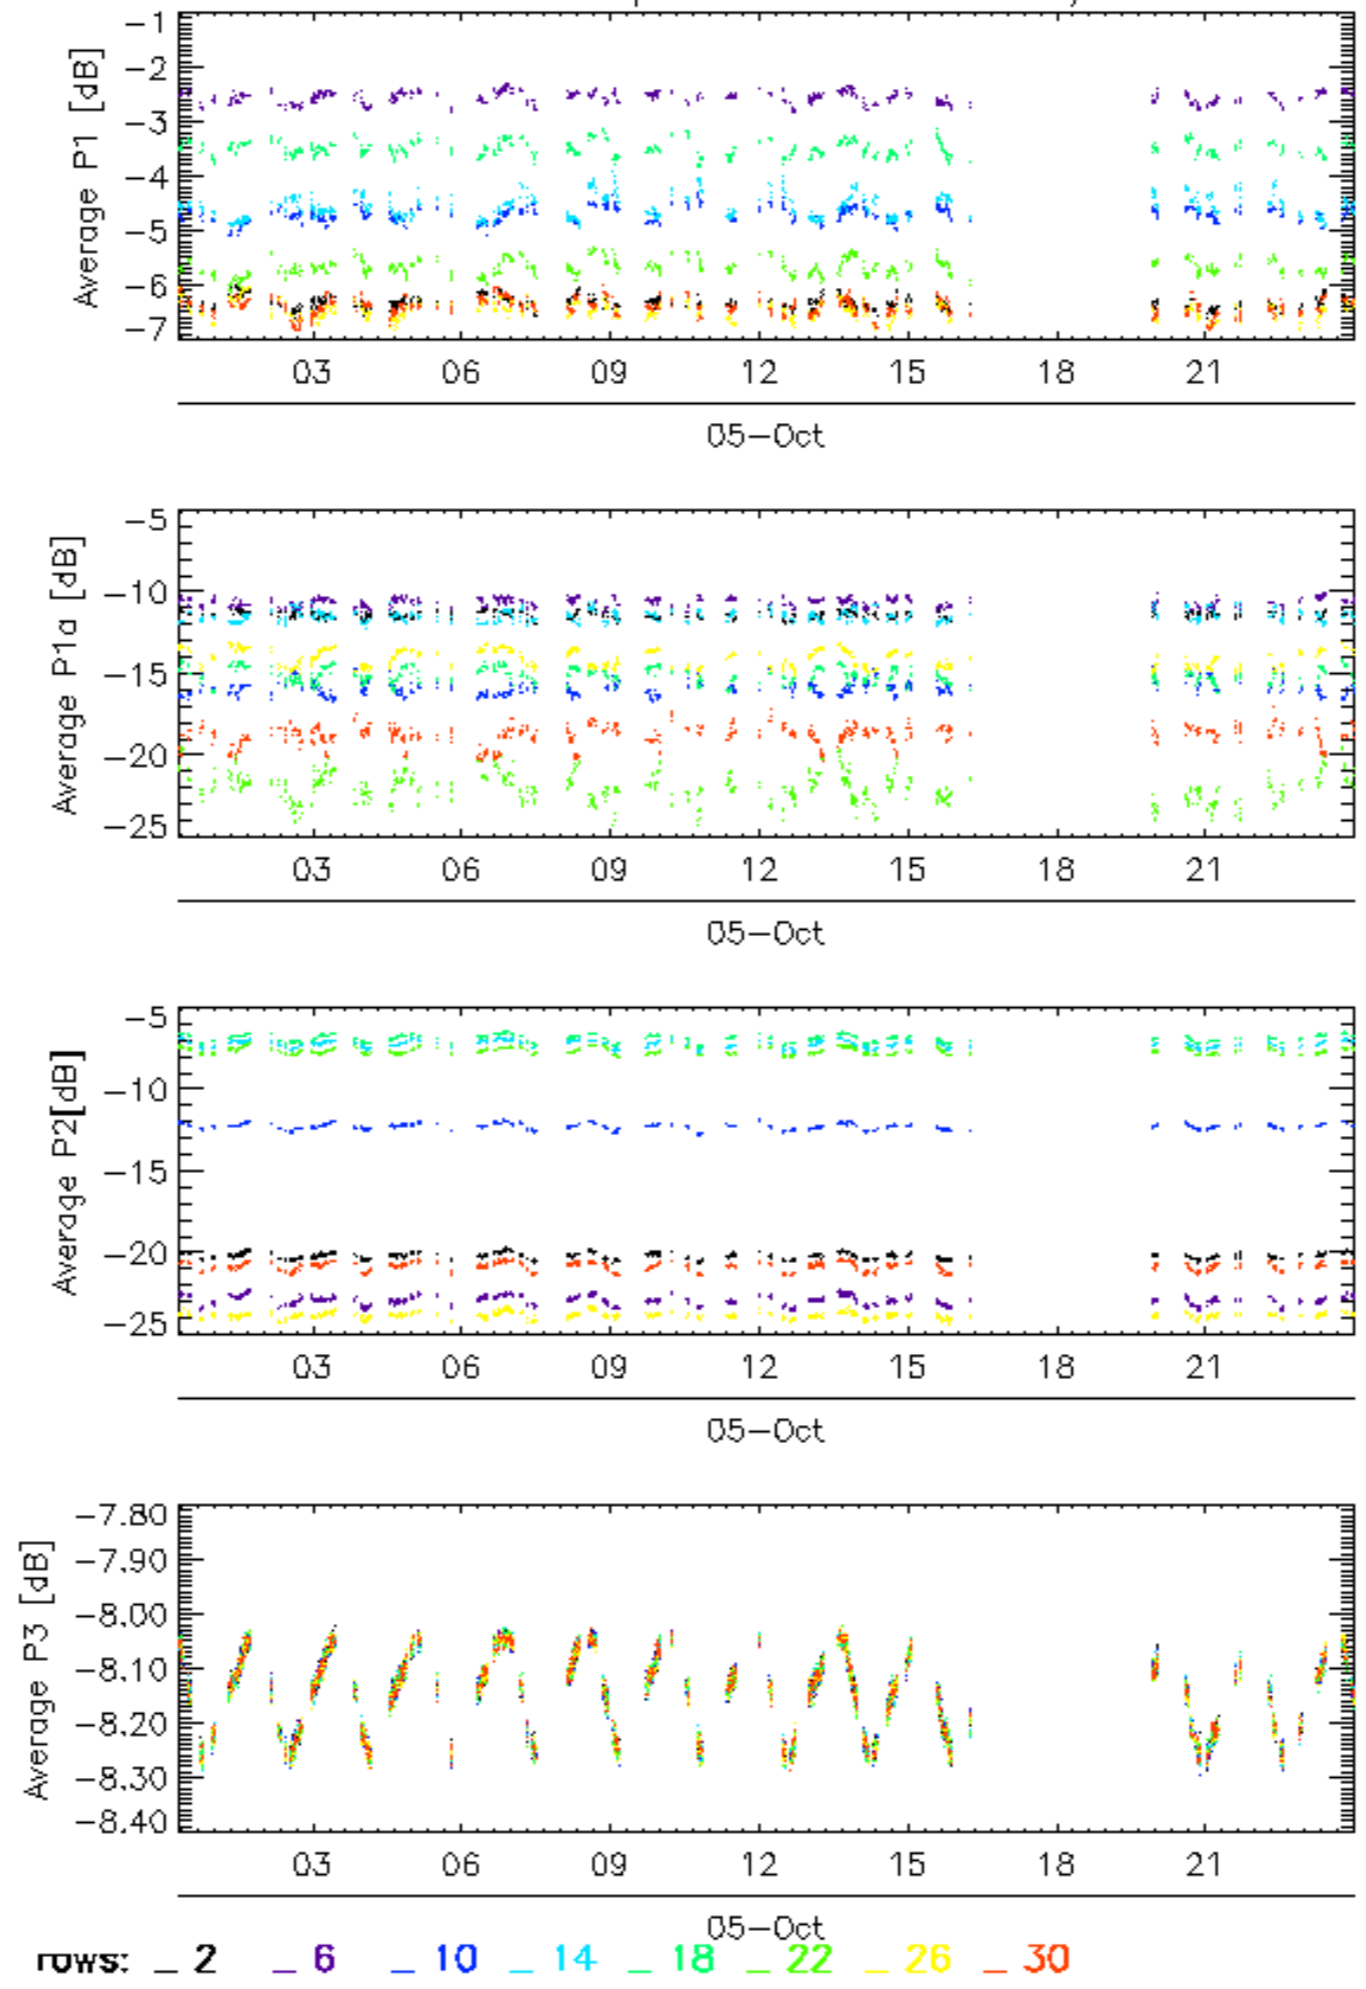


Calibration pulses for GM1 SS3 H/H

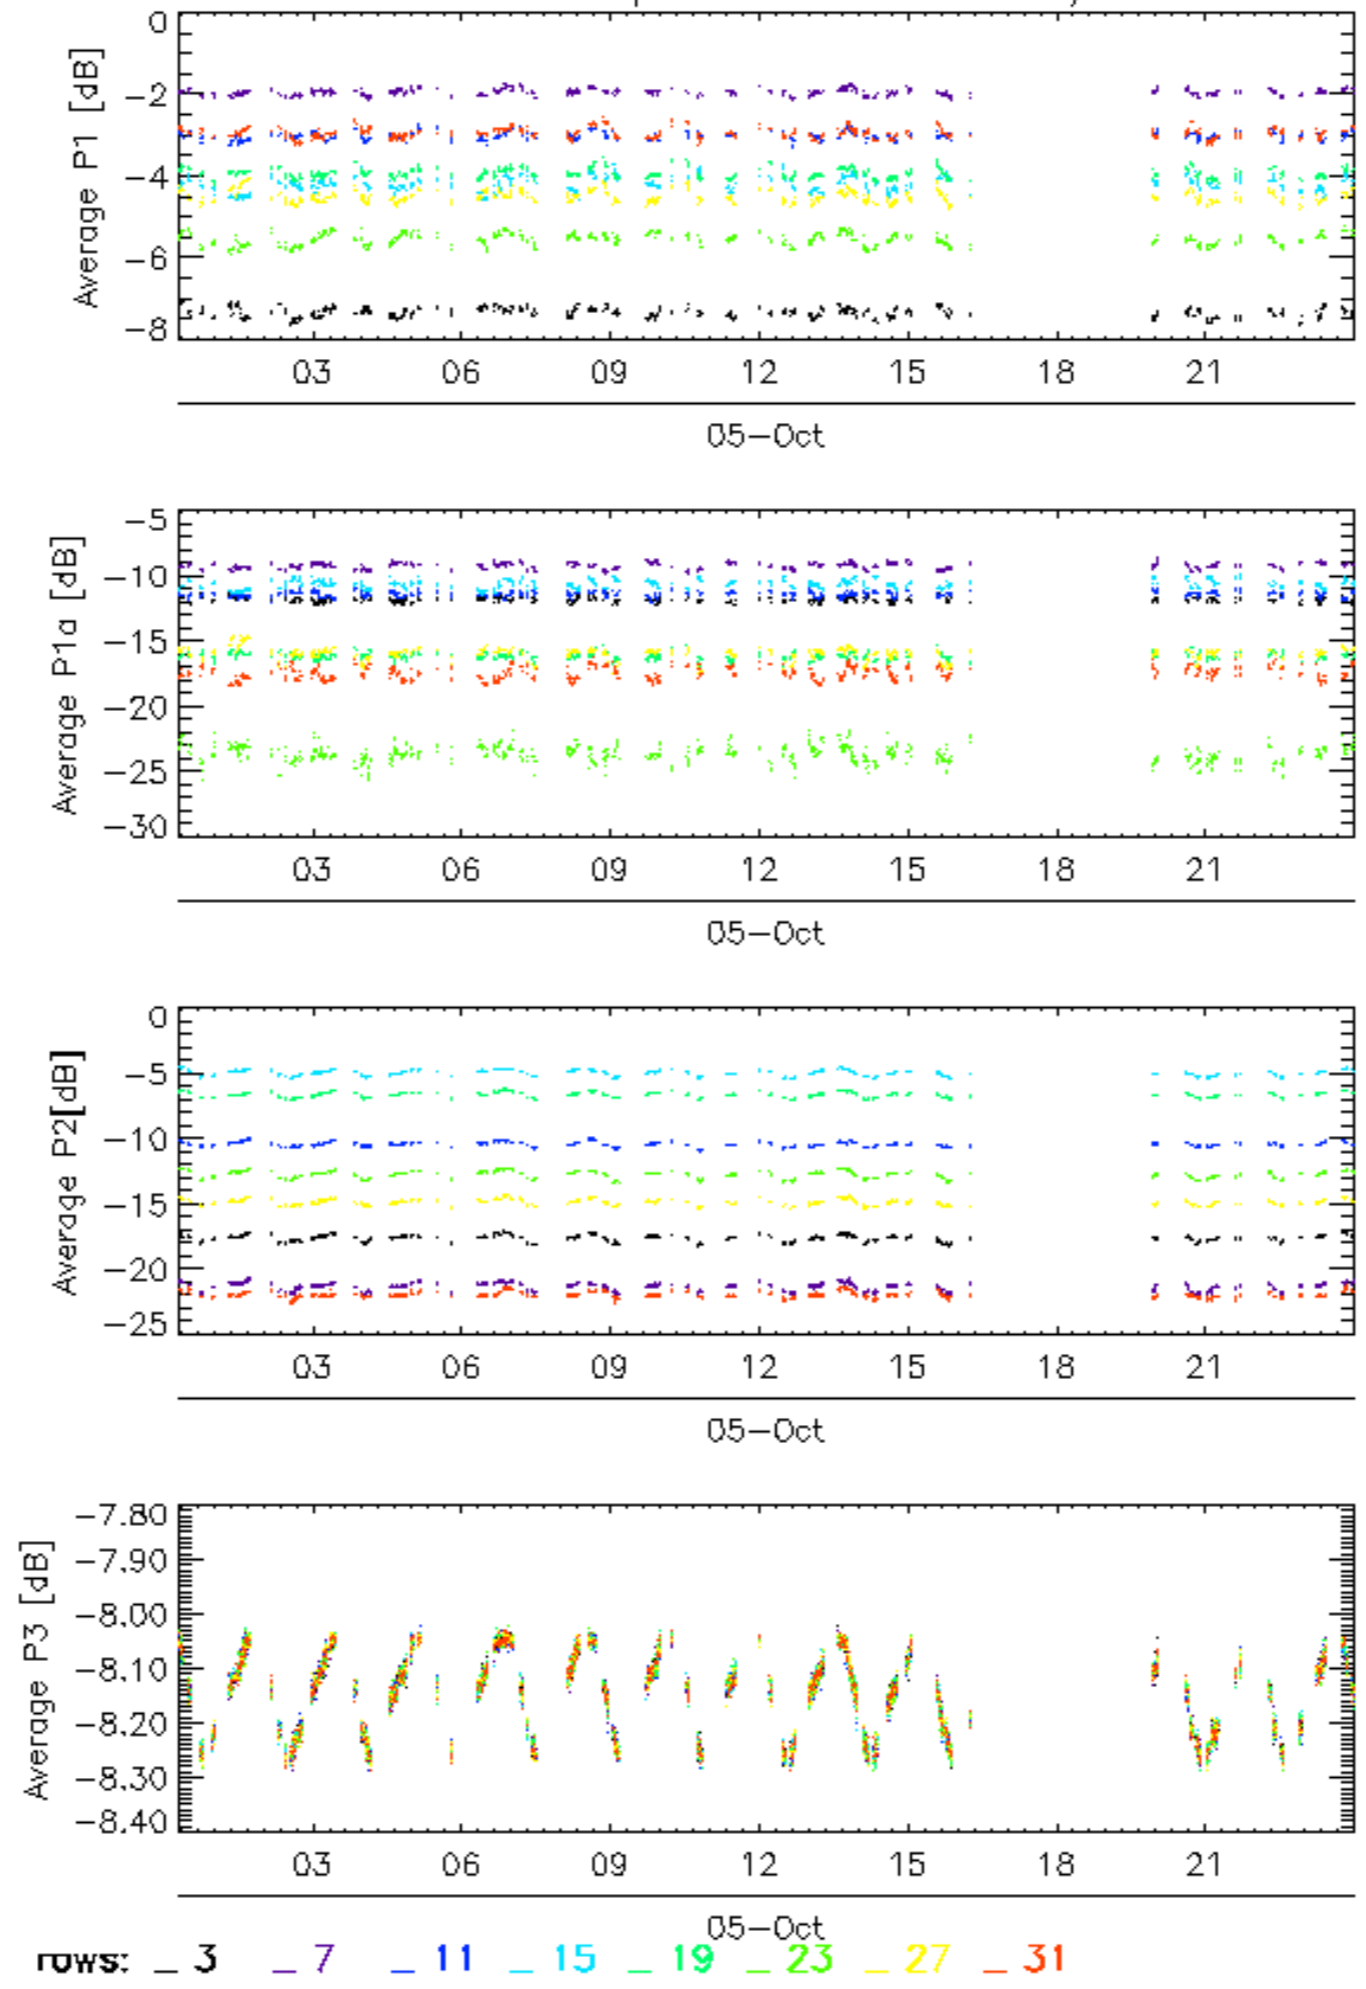


Calibration pulses for GM1 SS3 H/H

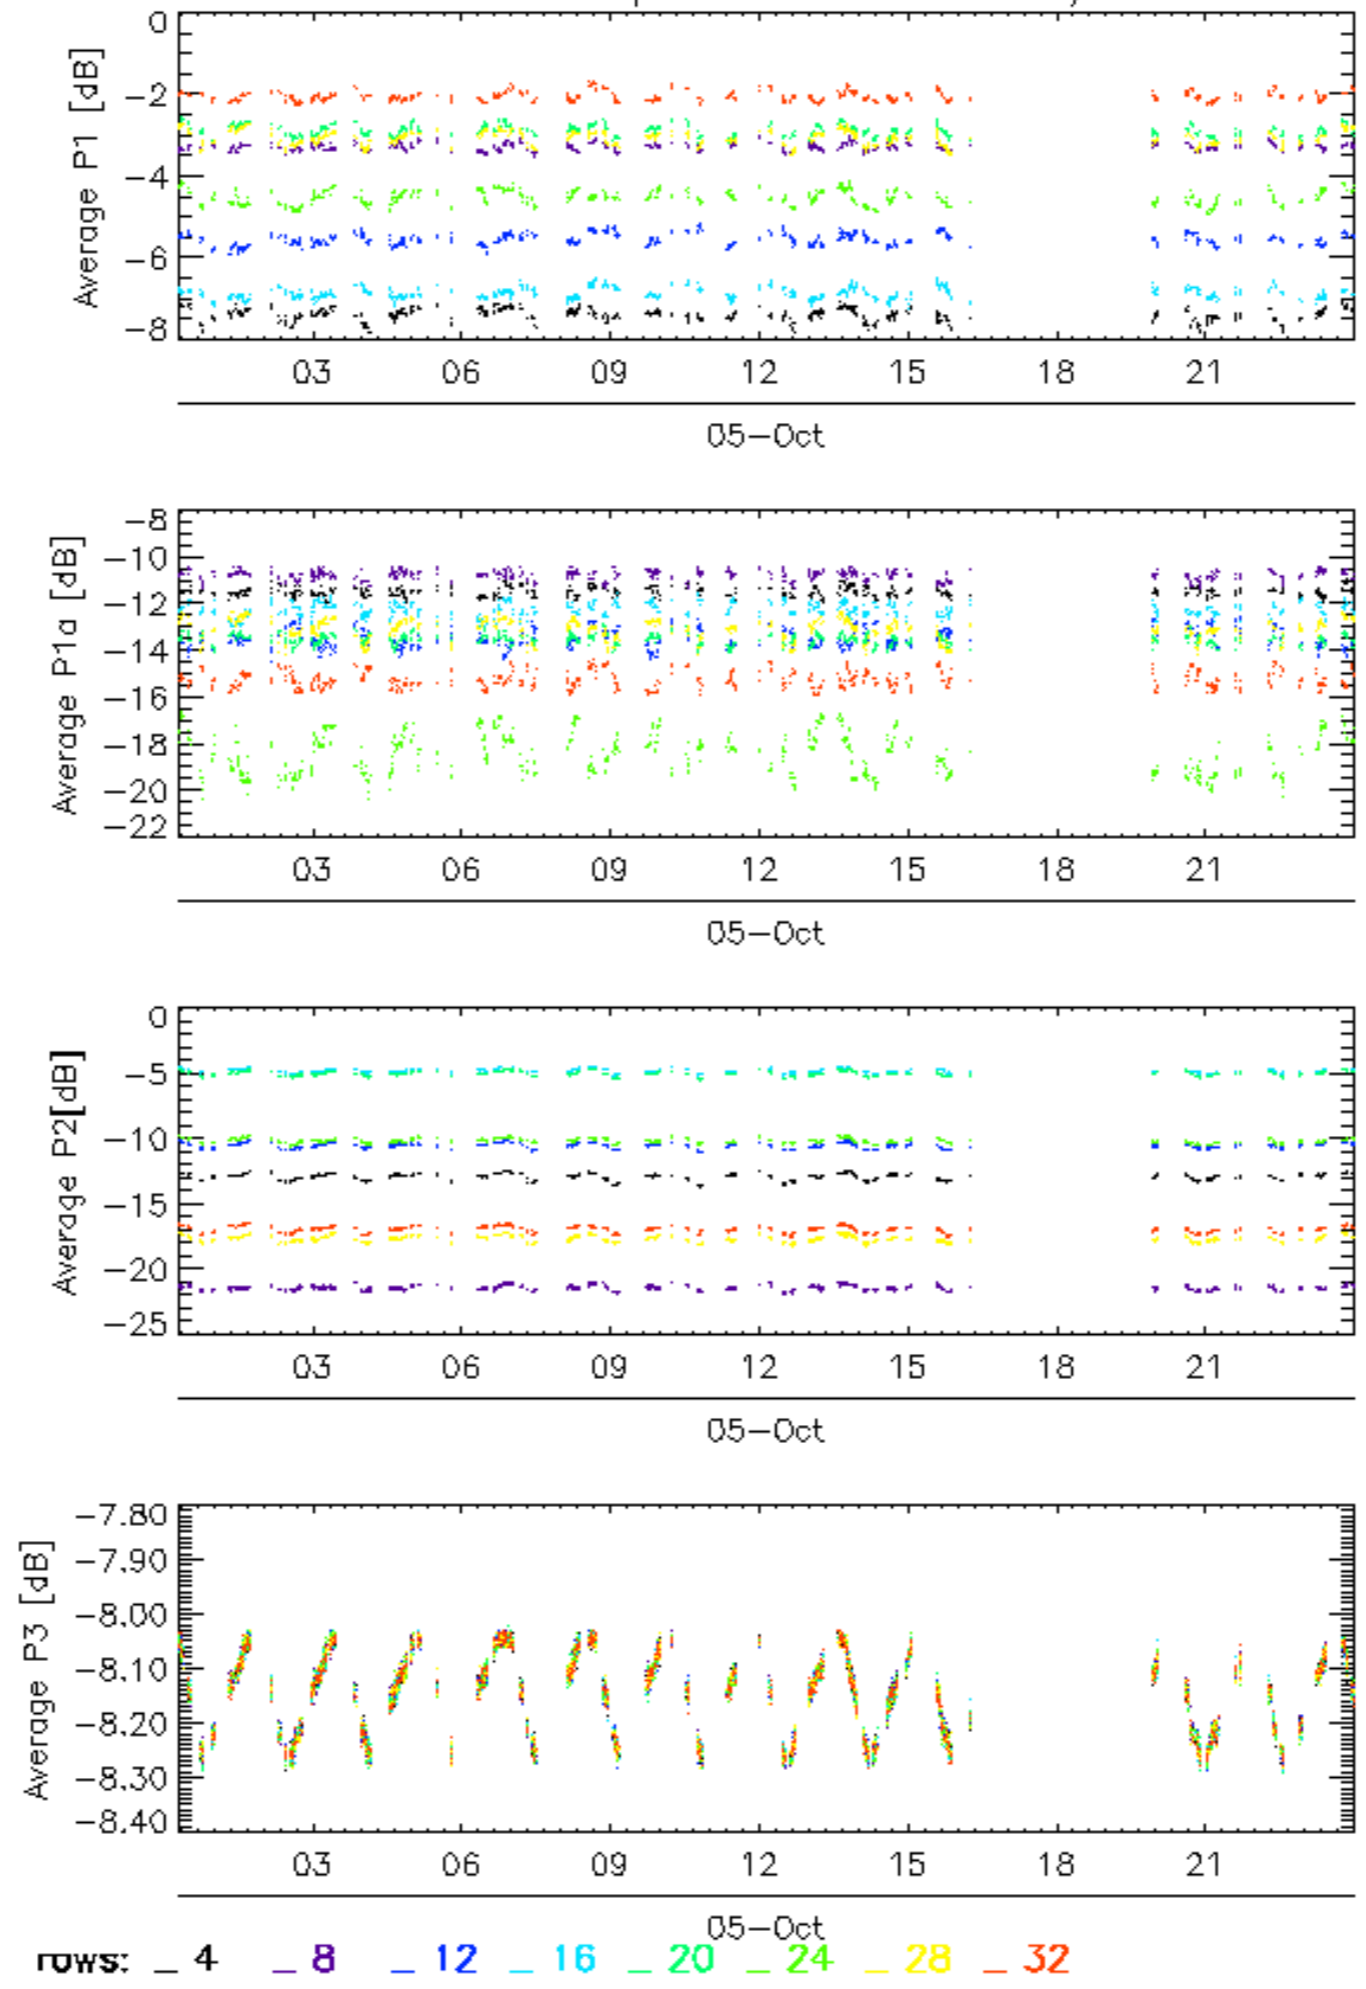


Calibration pulses for WVS IS2 V/V

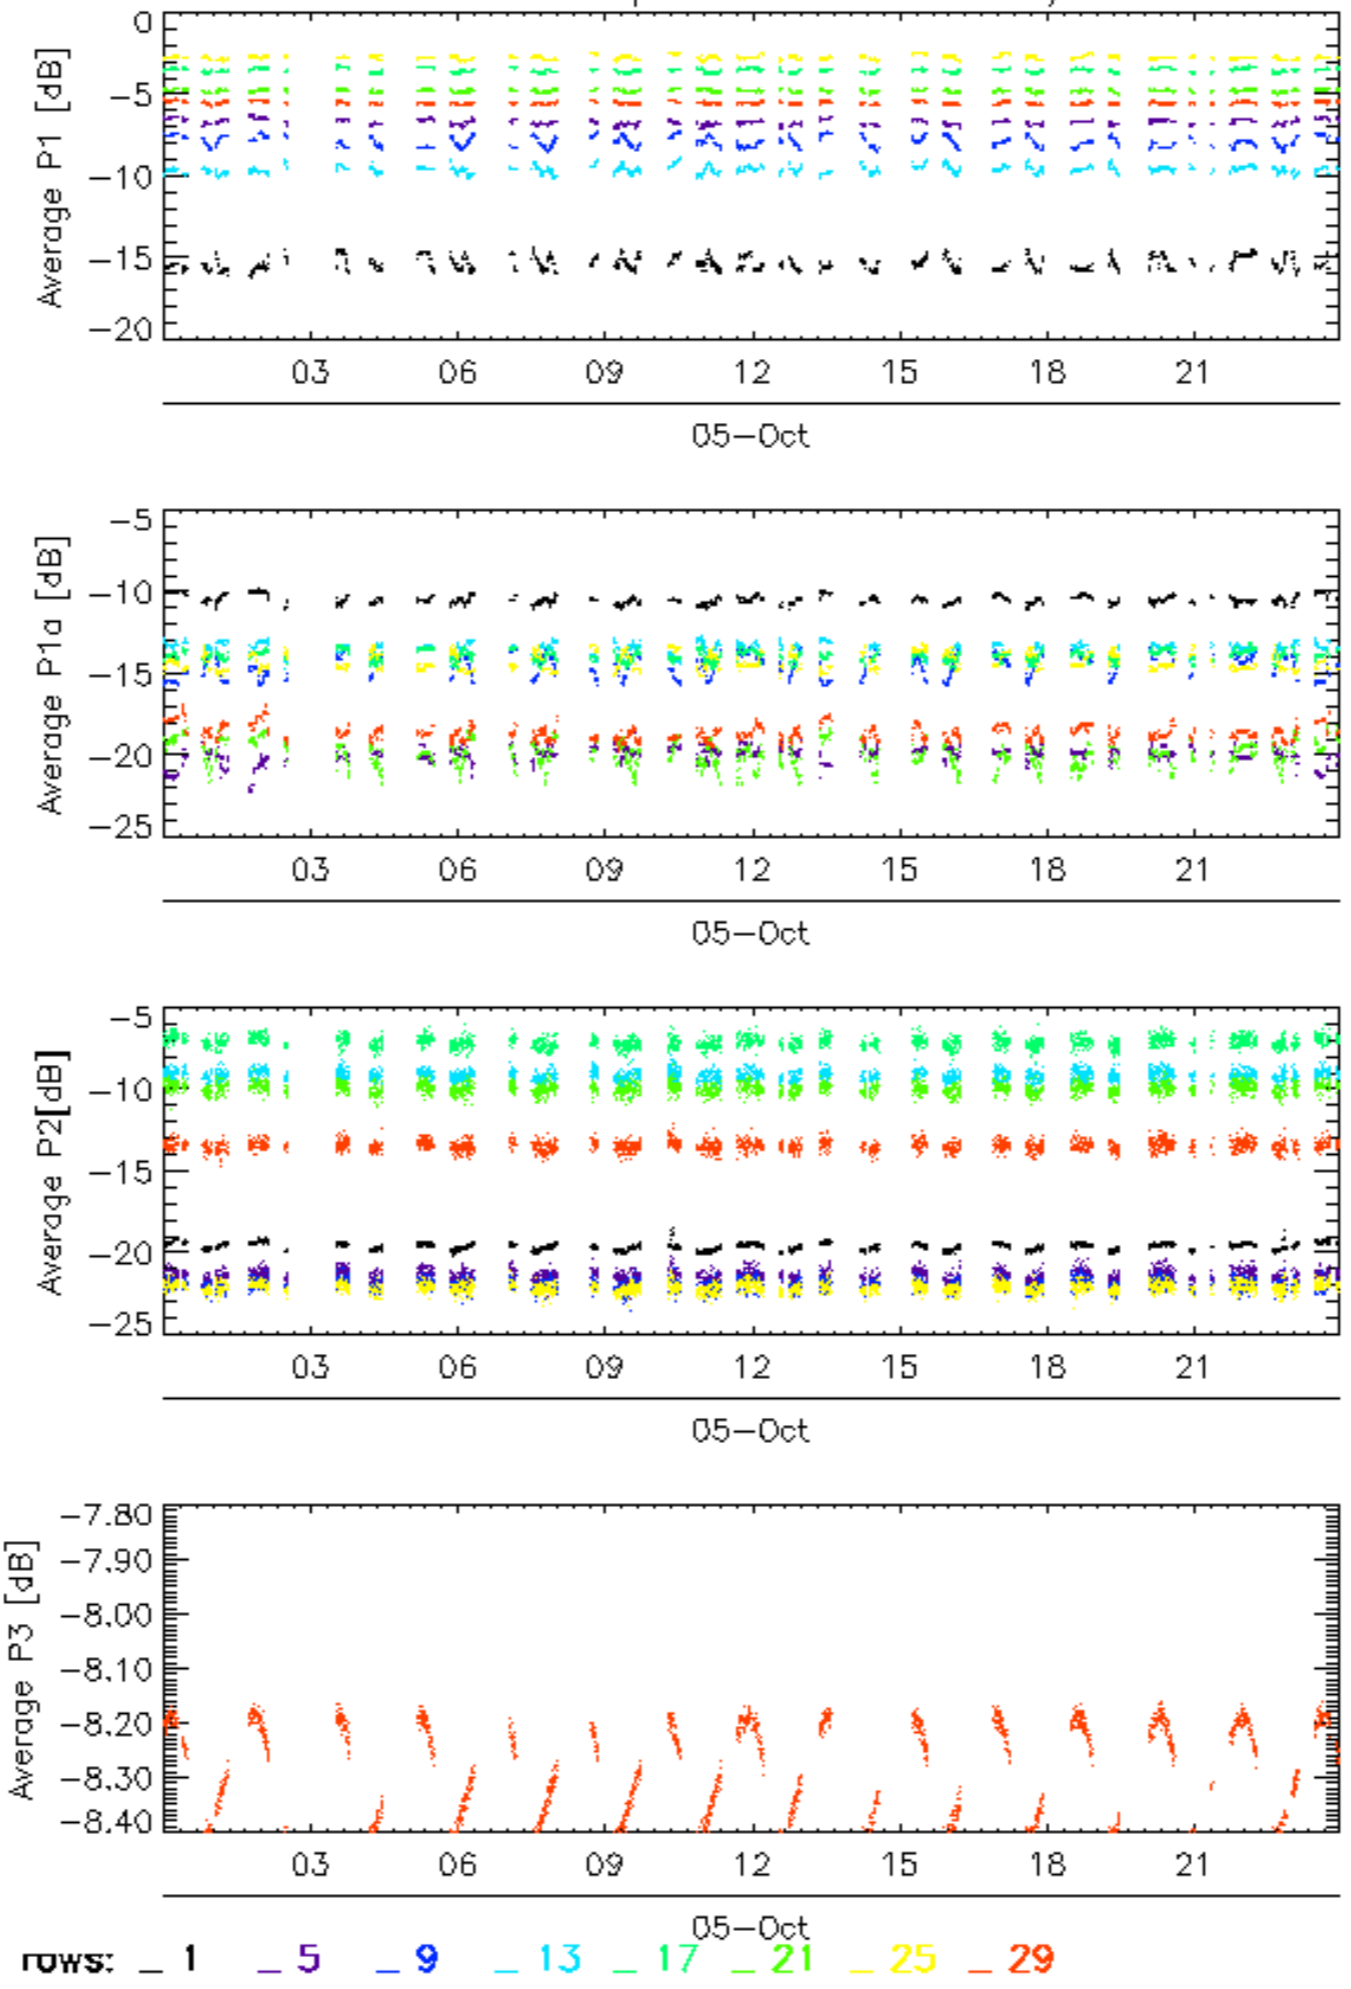


Calibration pulses for WVS IS2 V/V

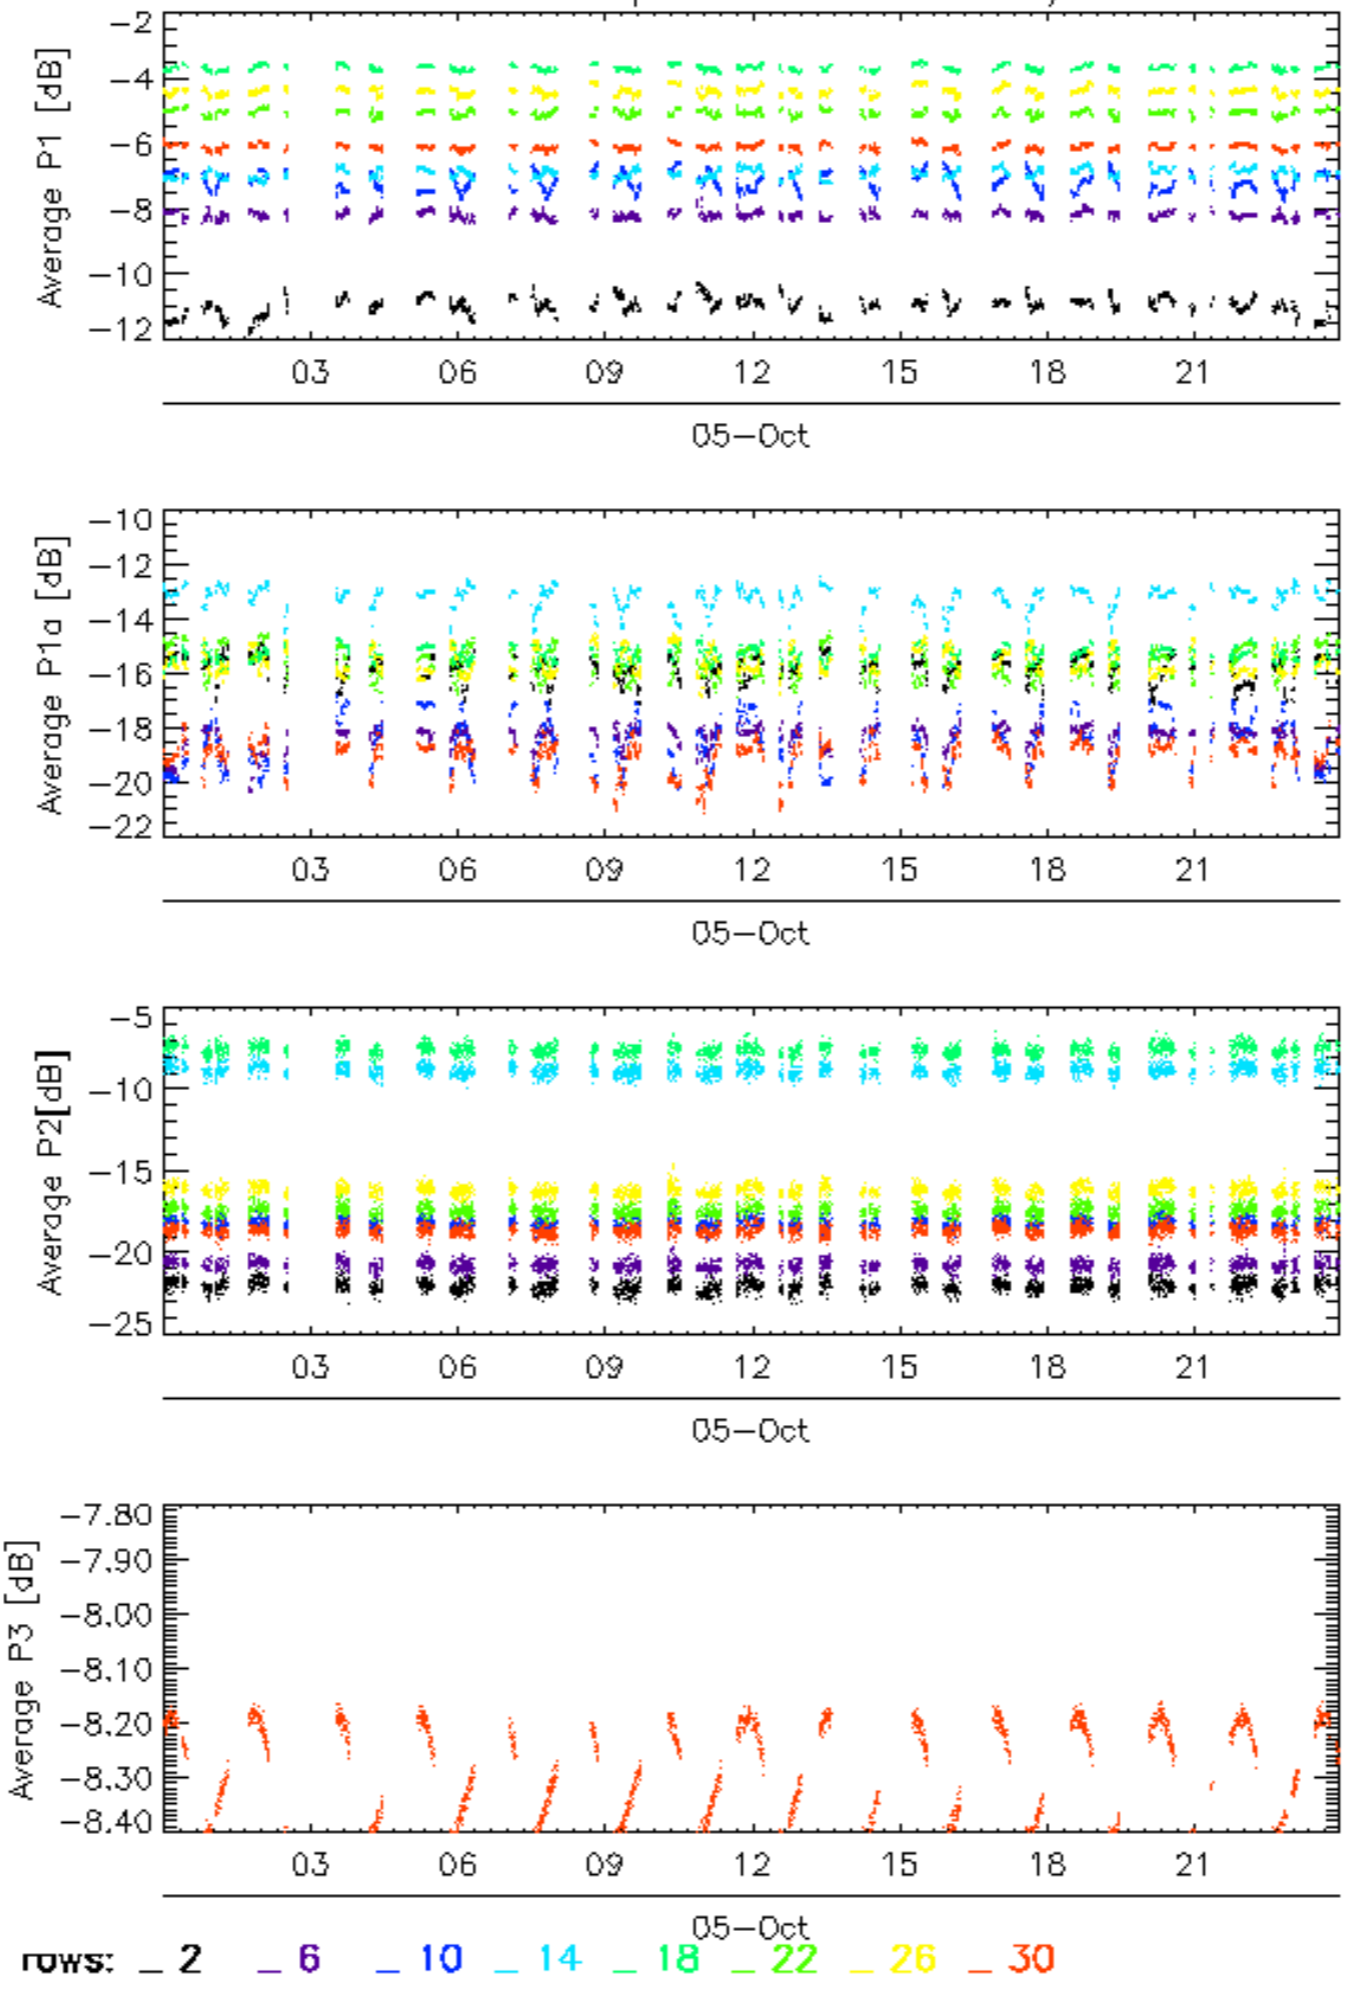



Calibration pulses for WVS IS2 V/V


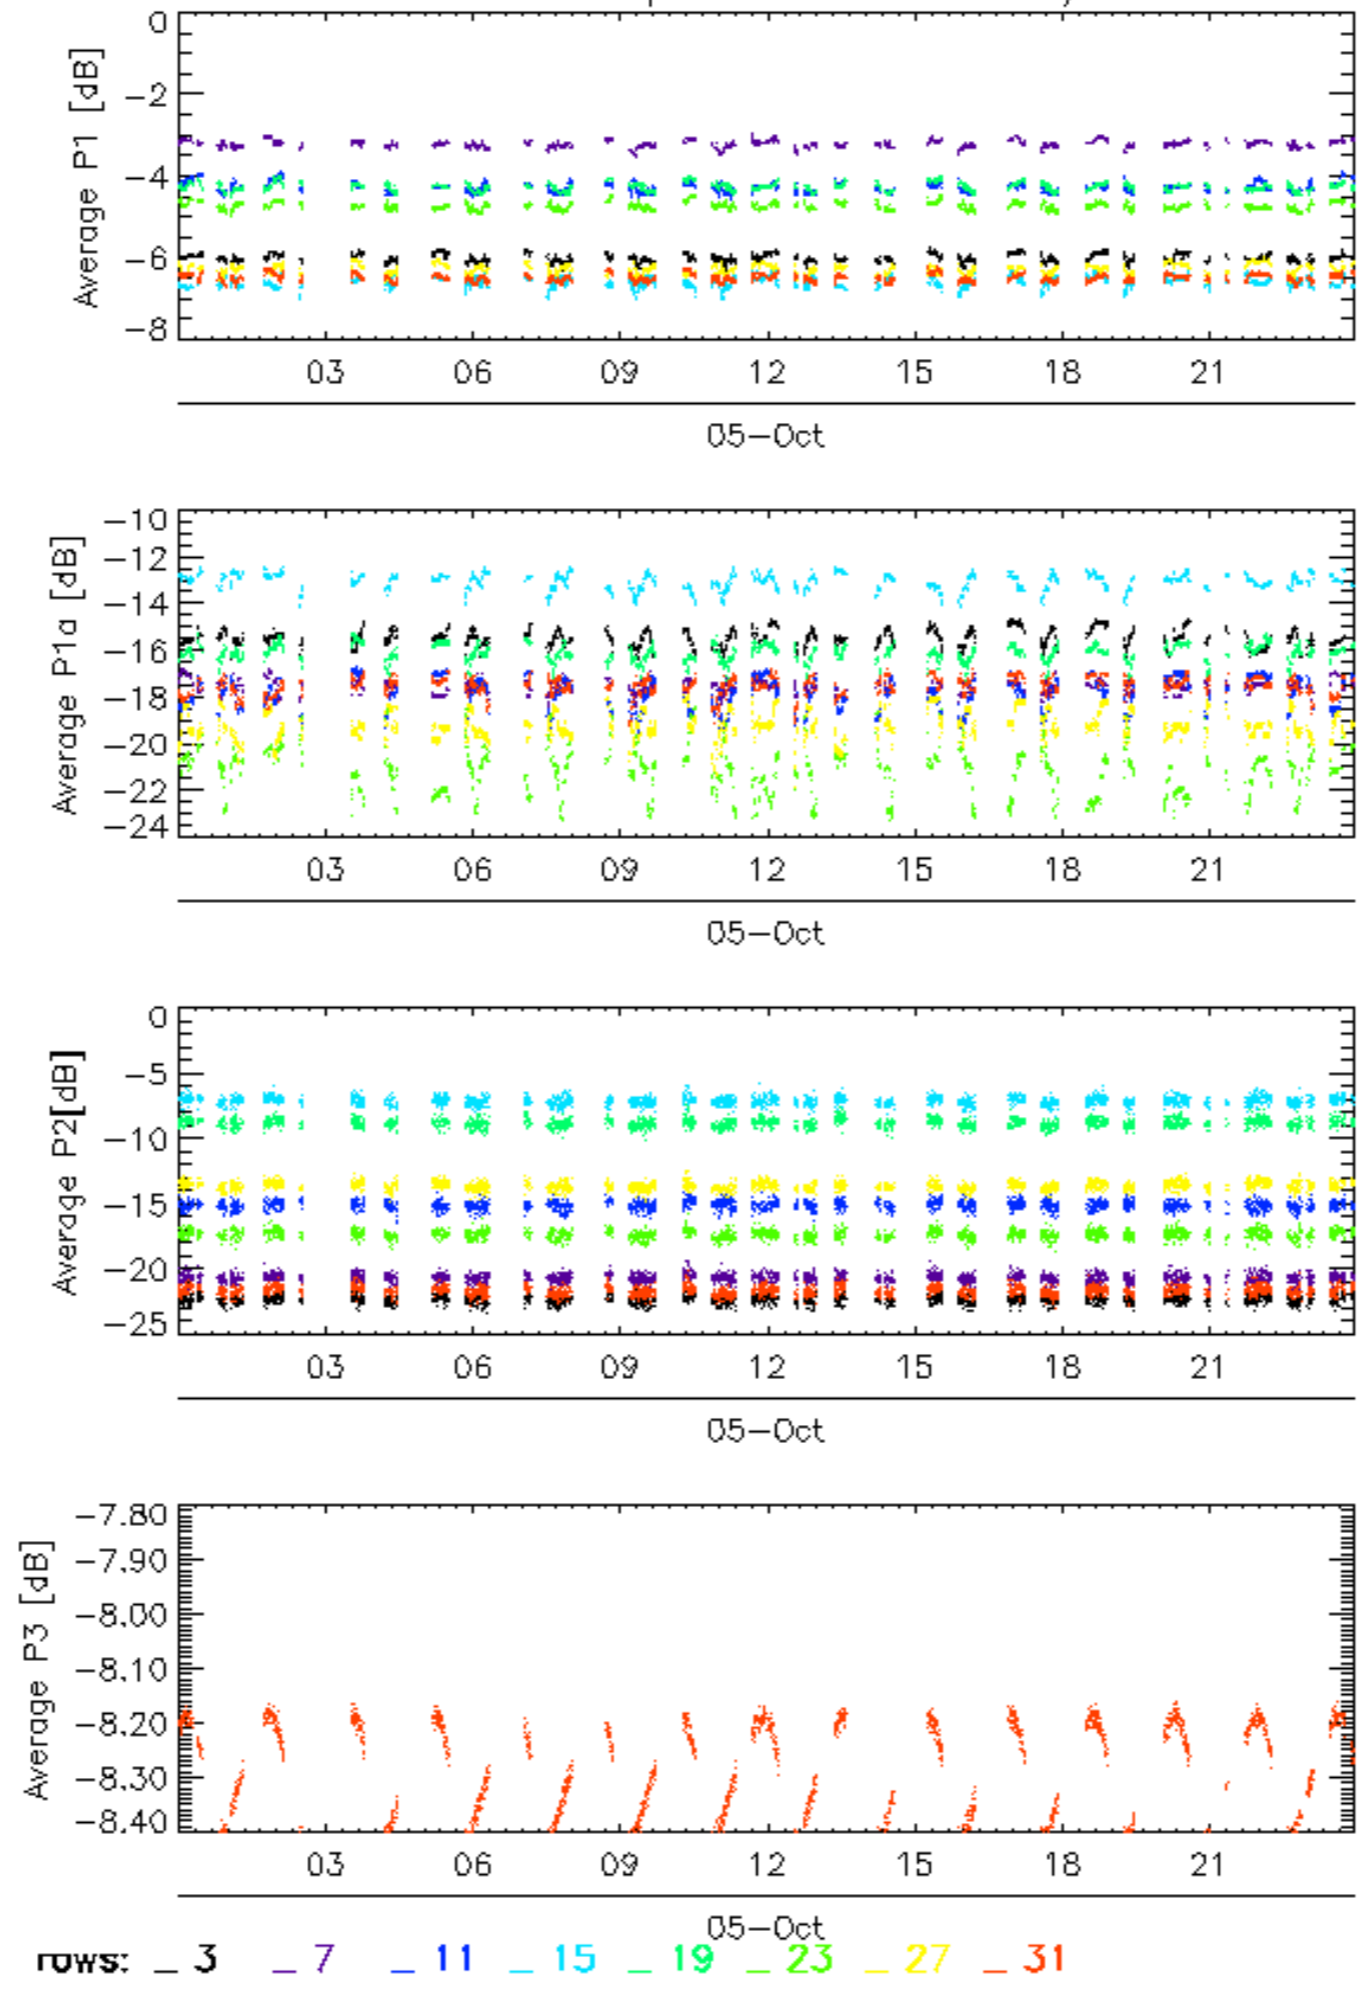




Calibration pulses for WVS IS2 V/V


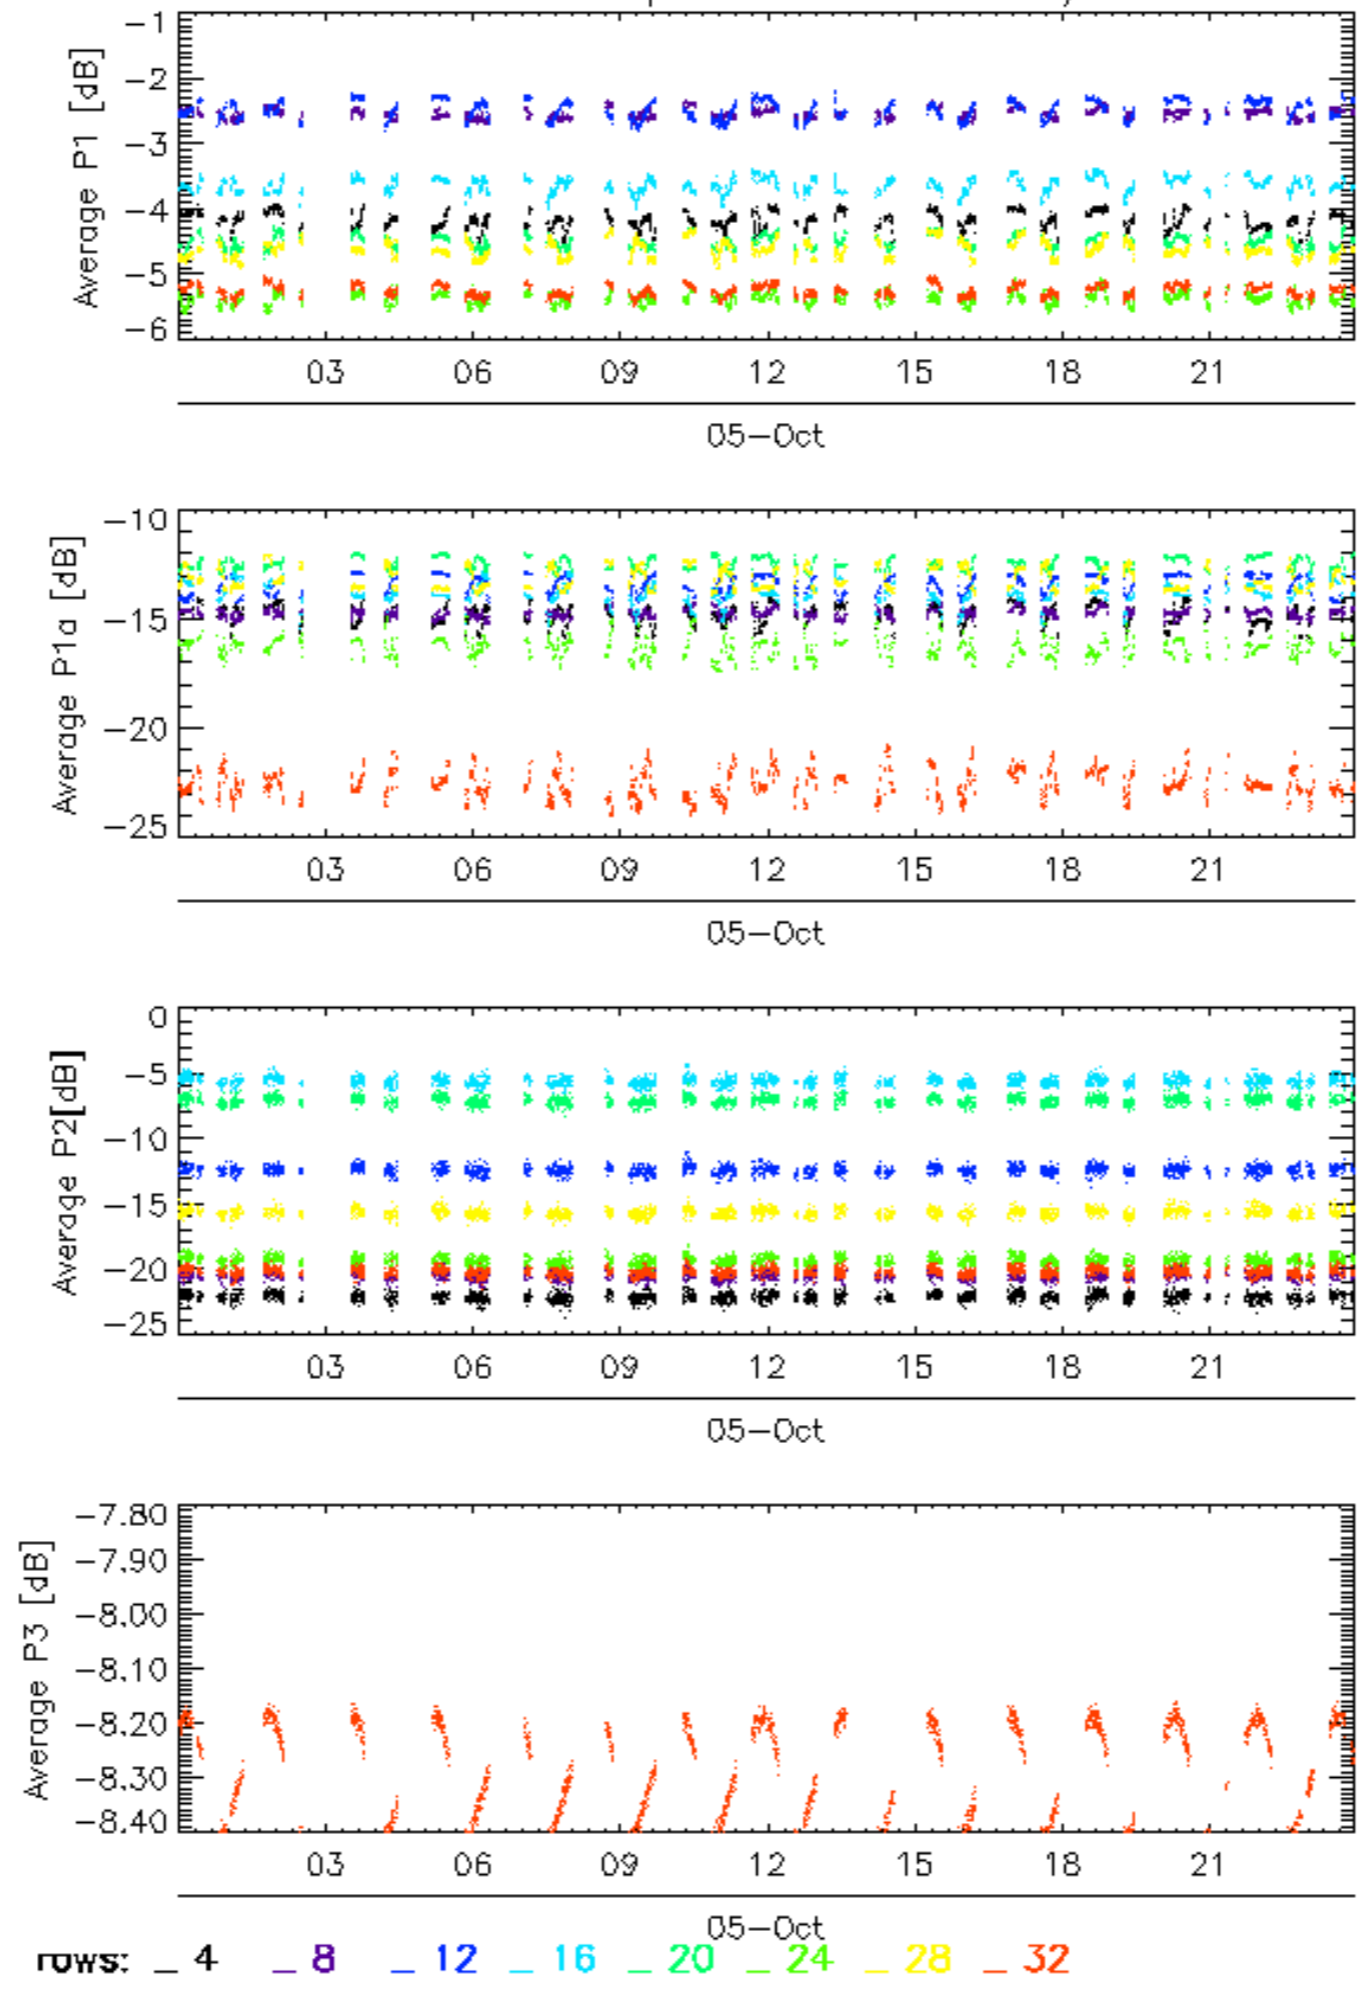



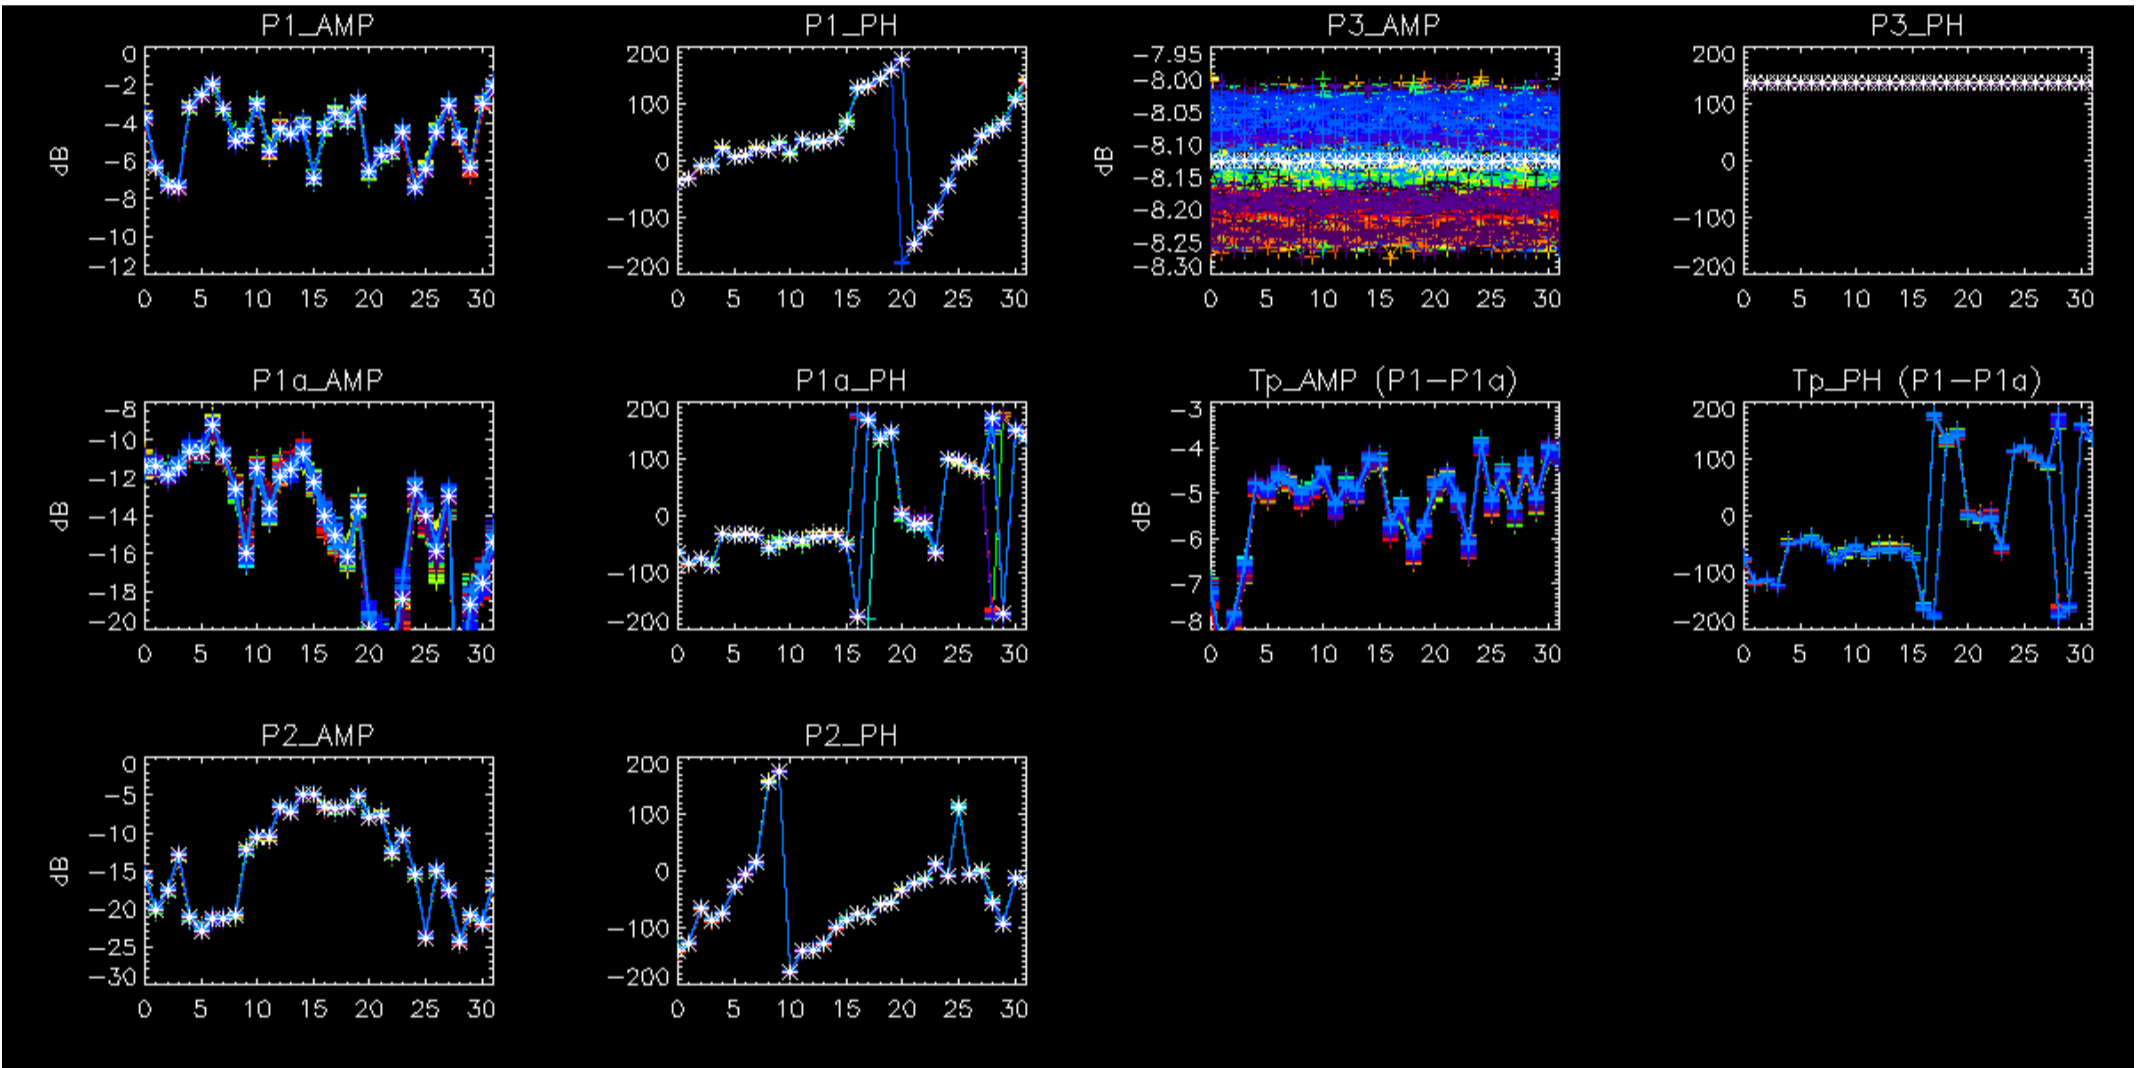



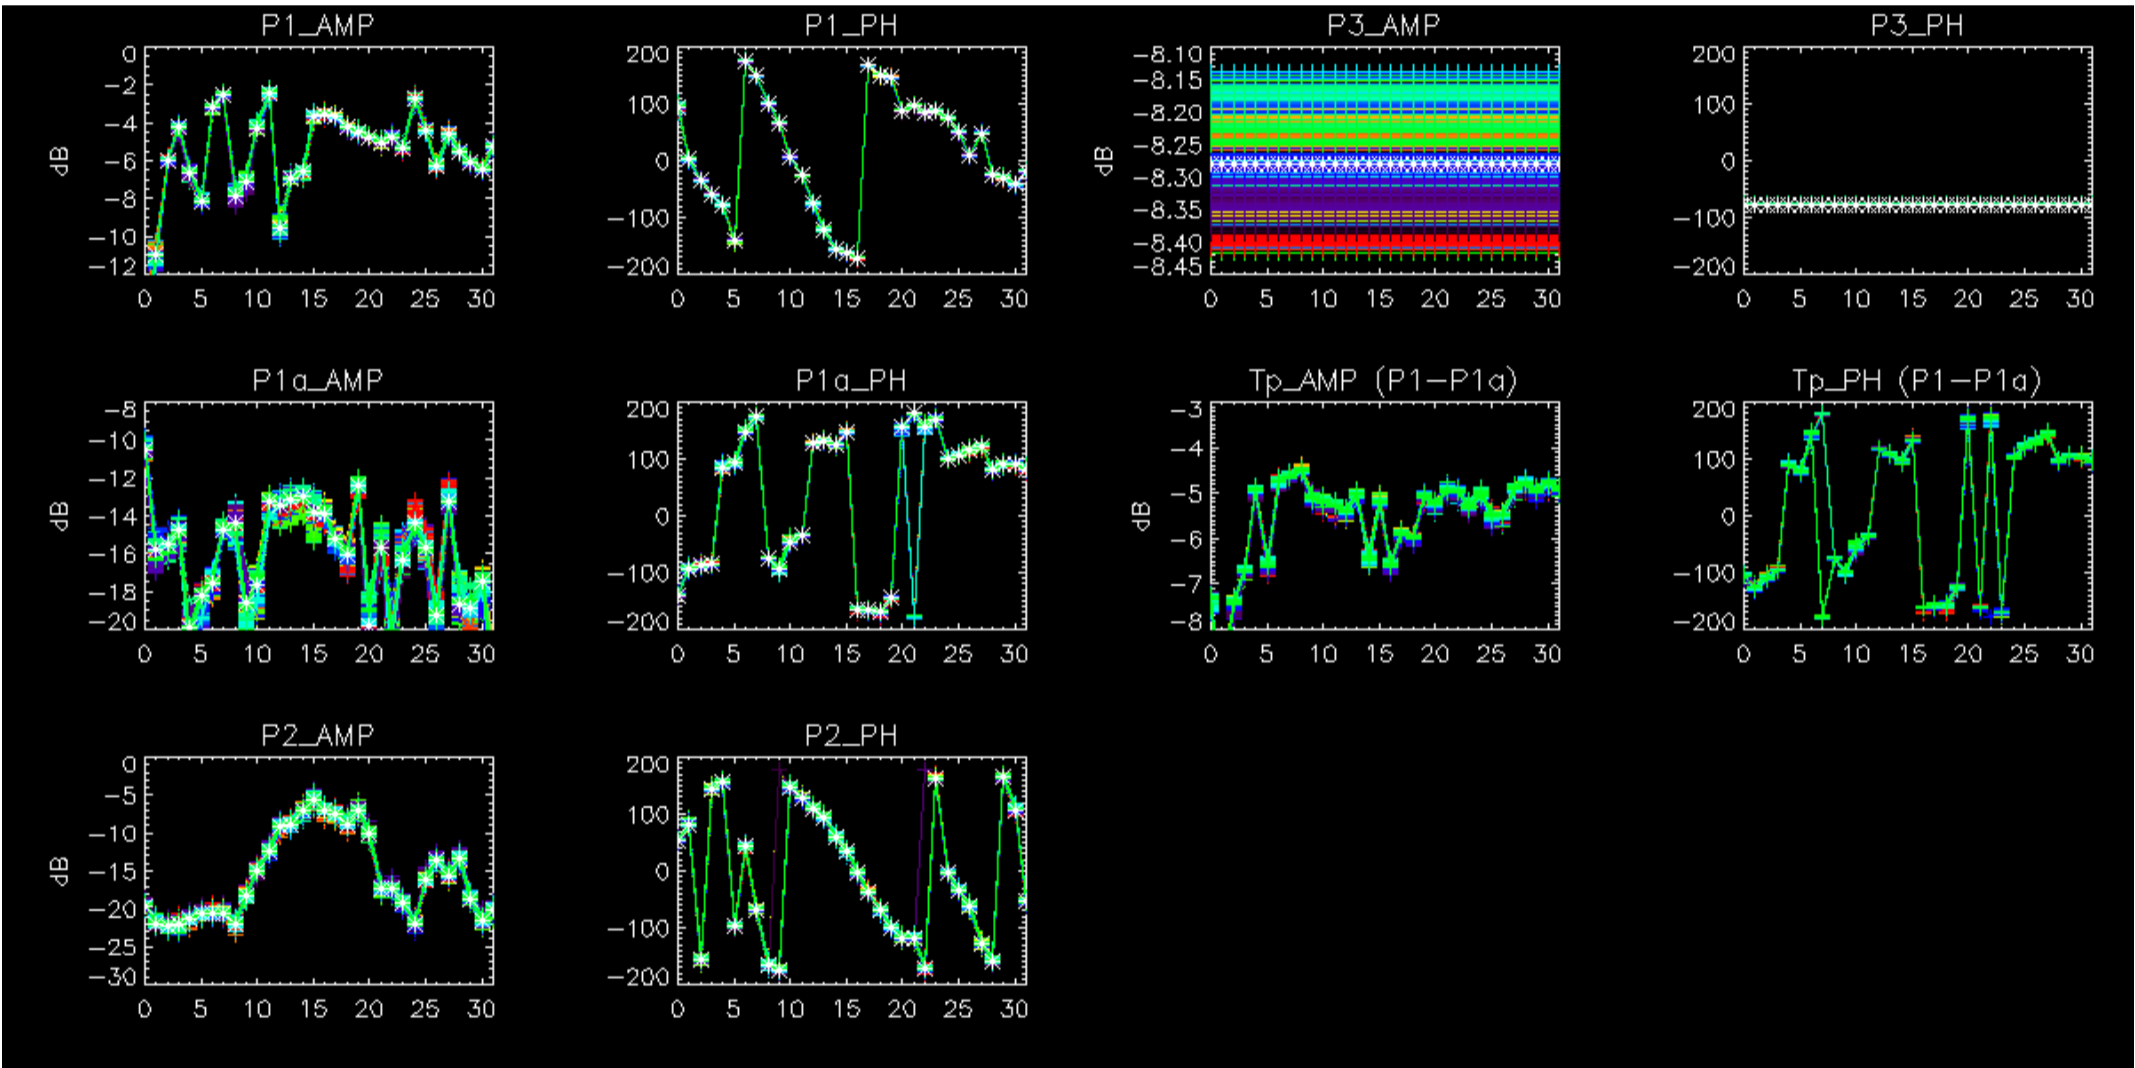


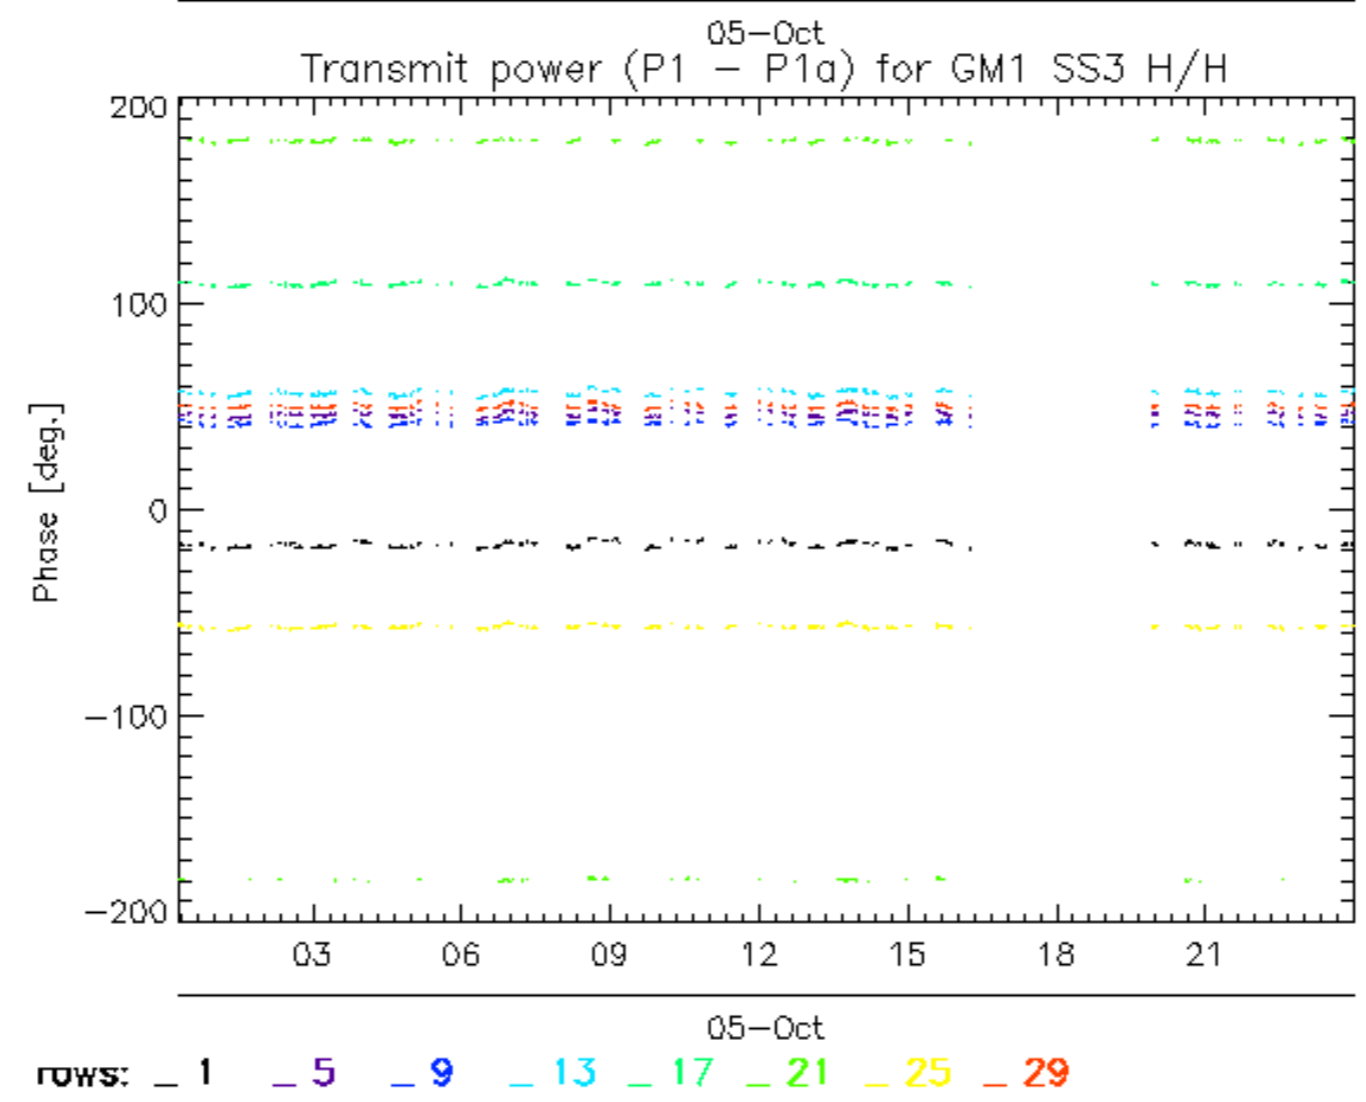
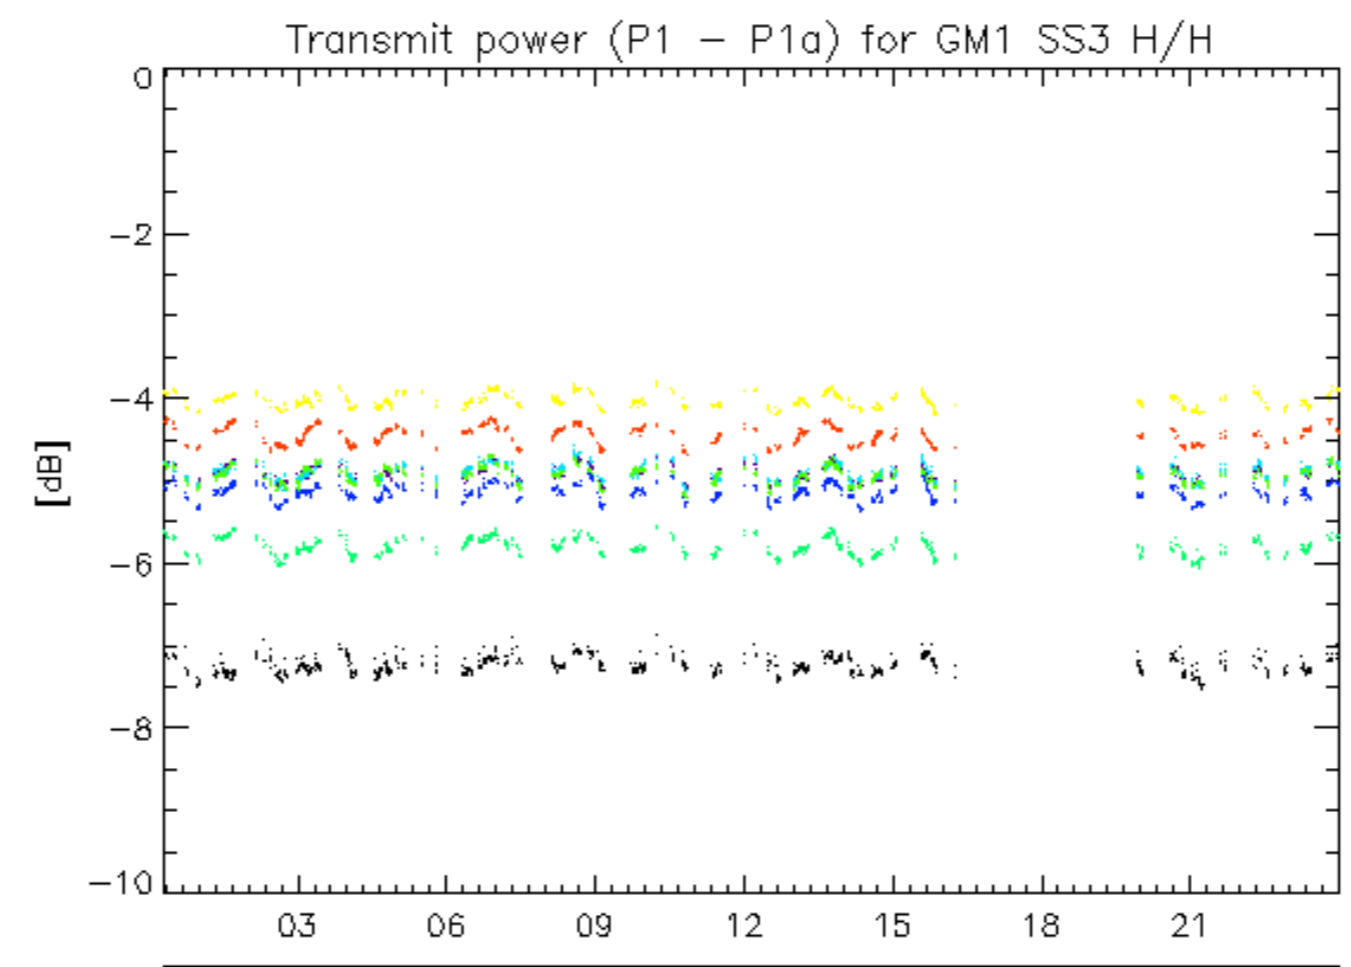


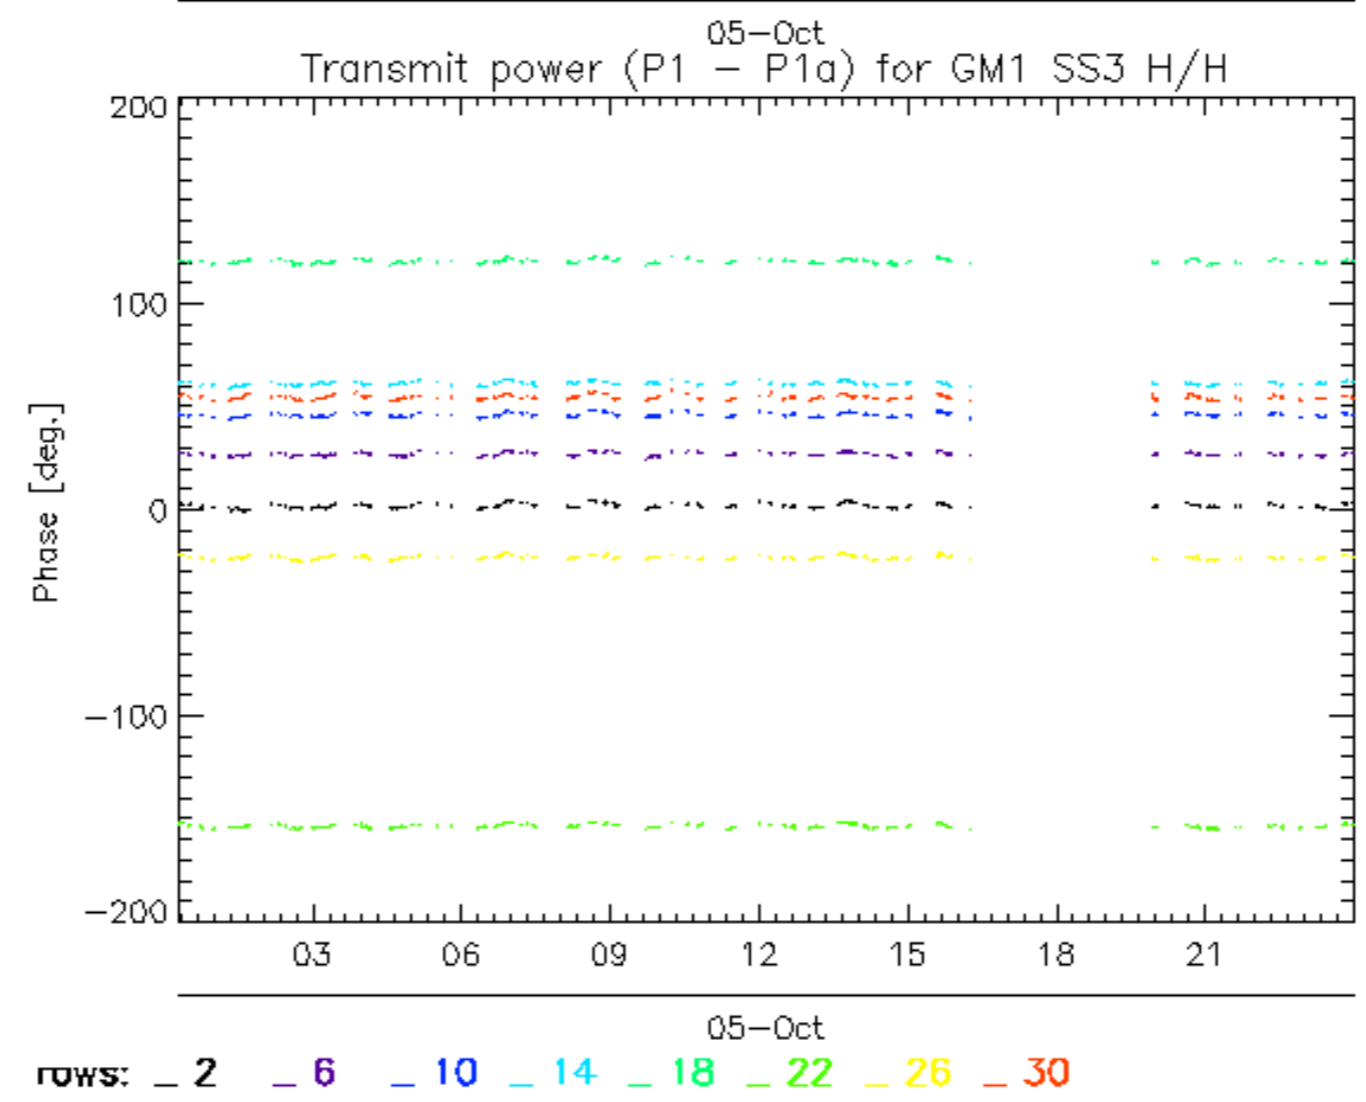
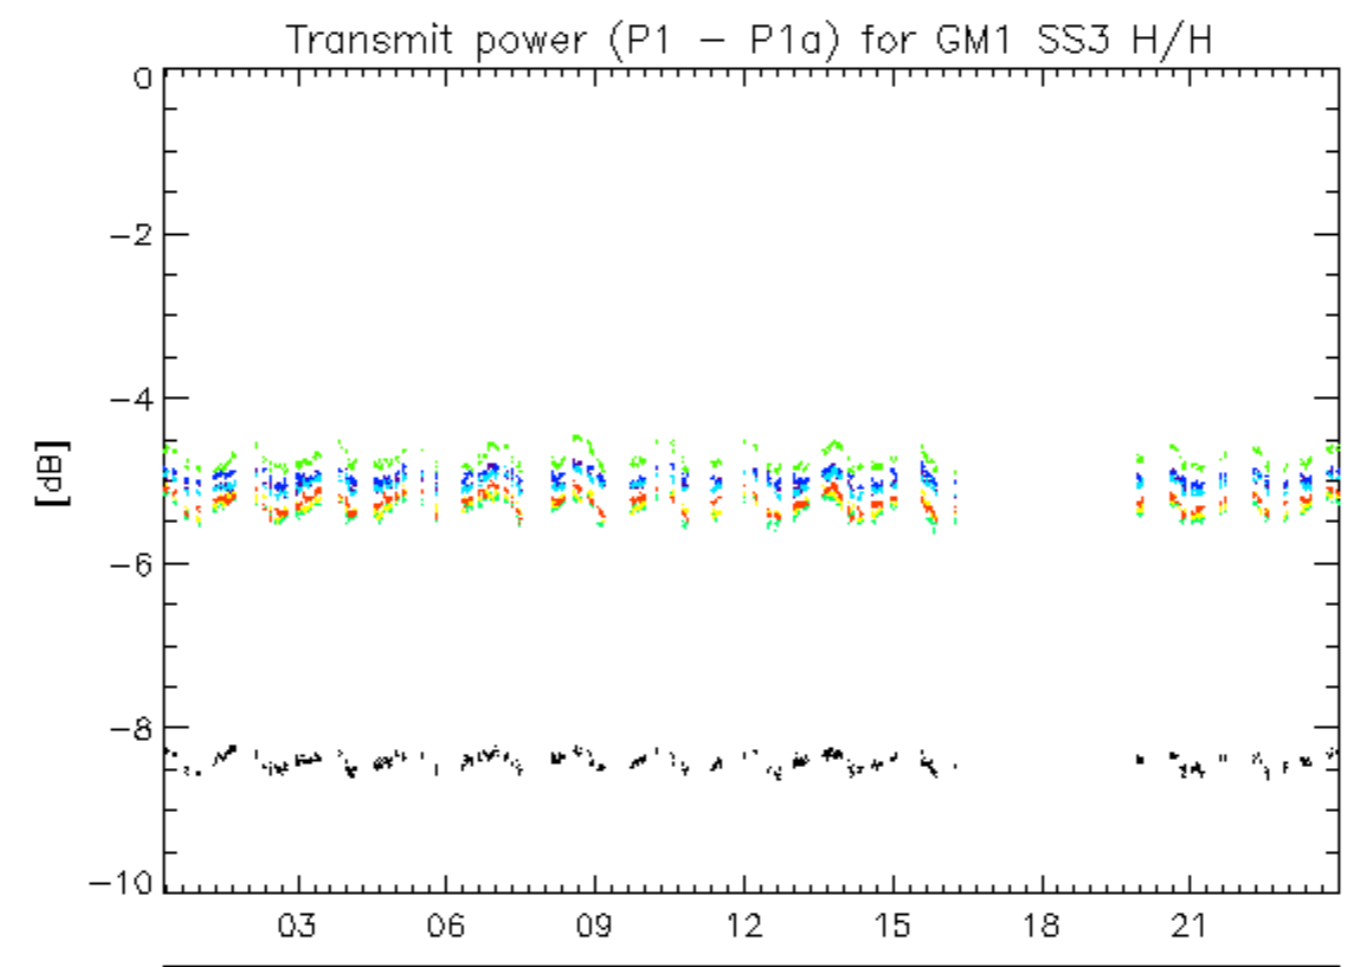


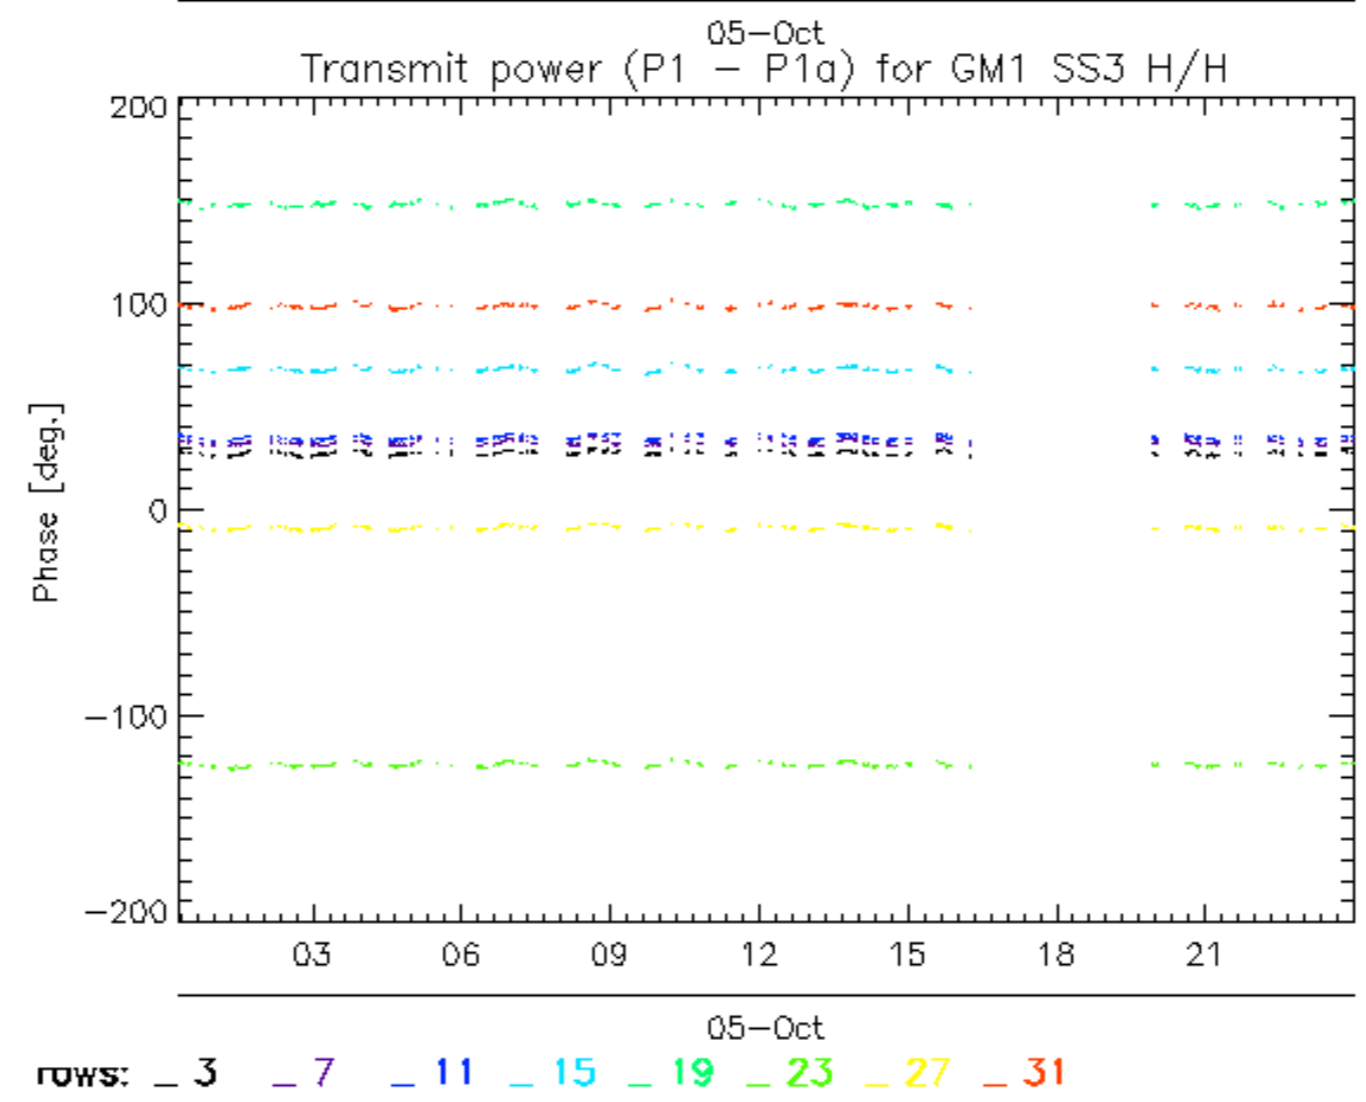
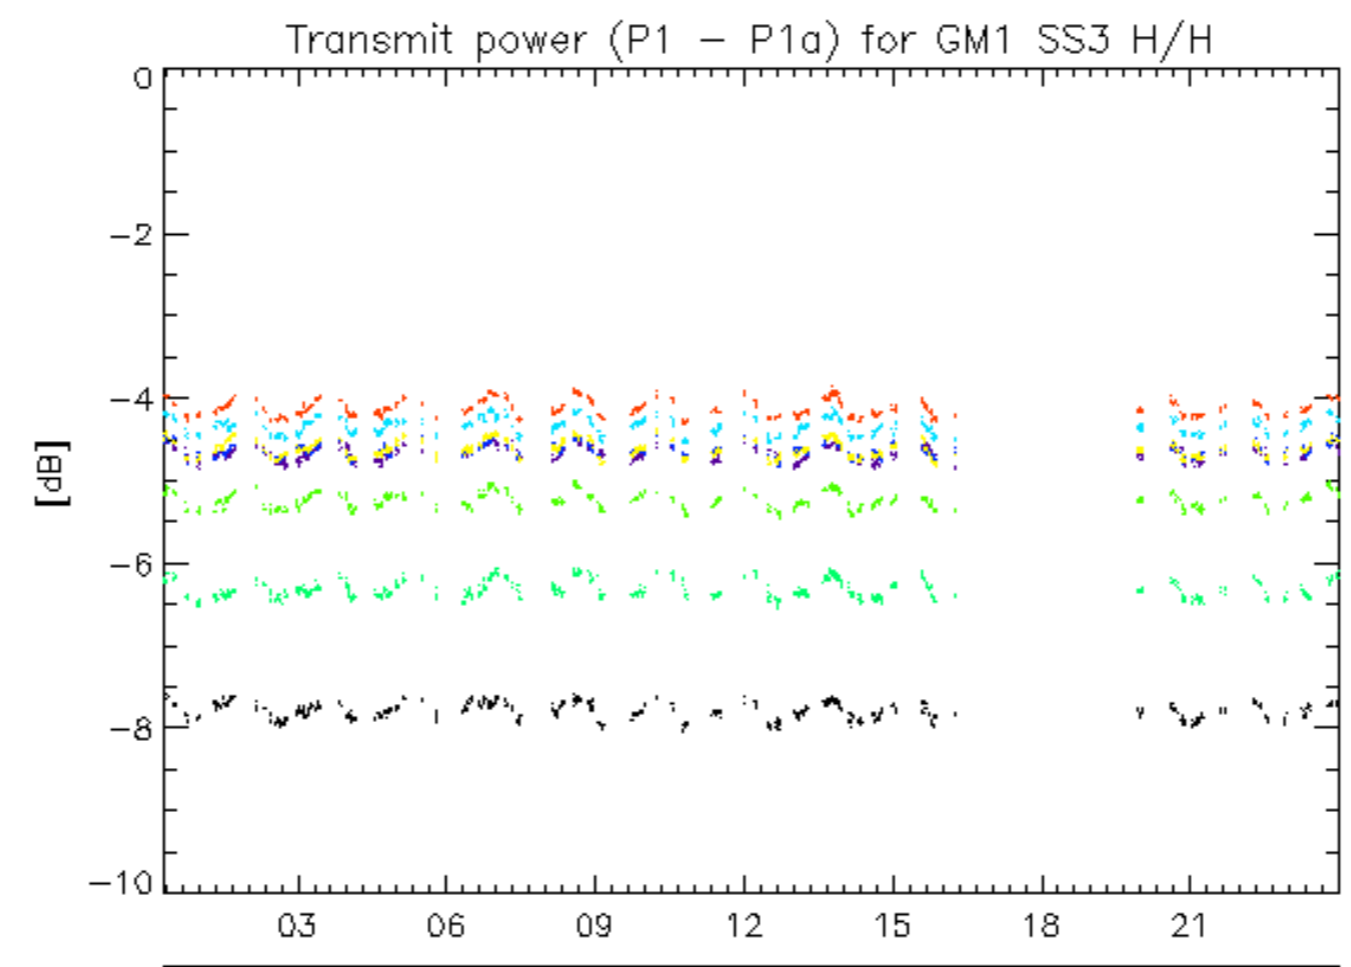


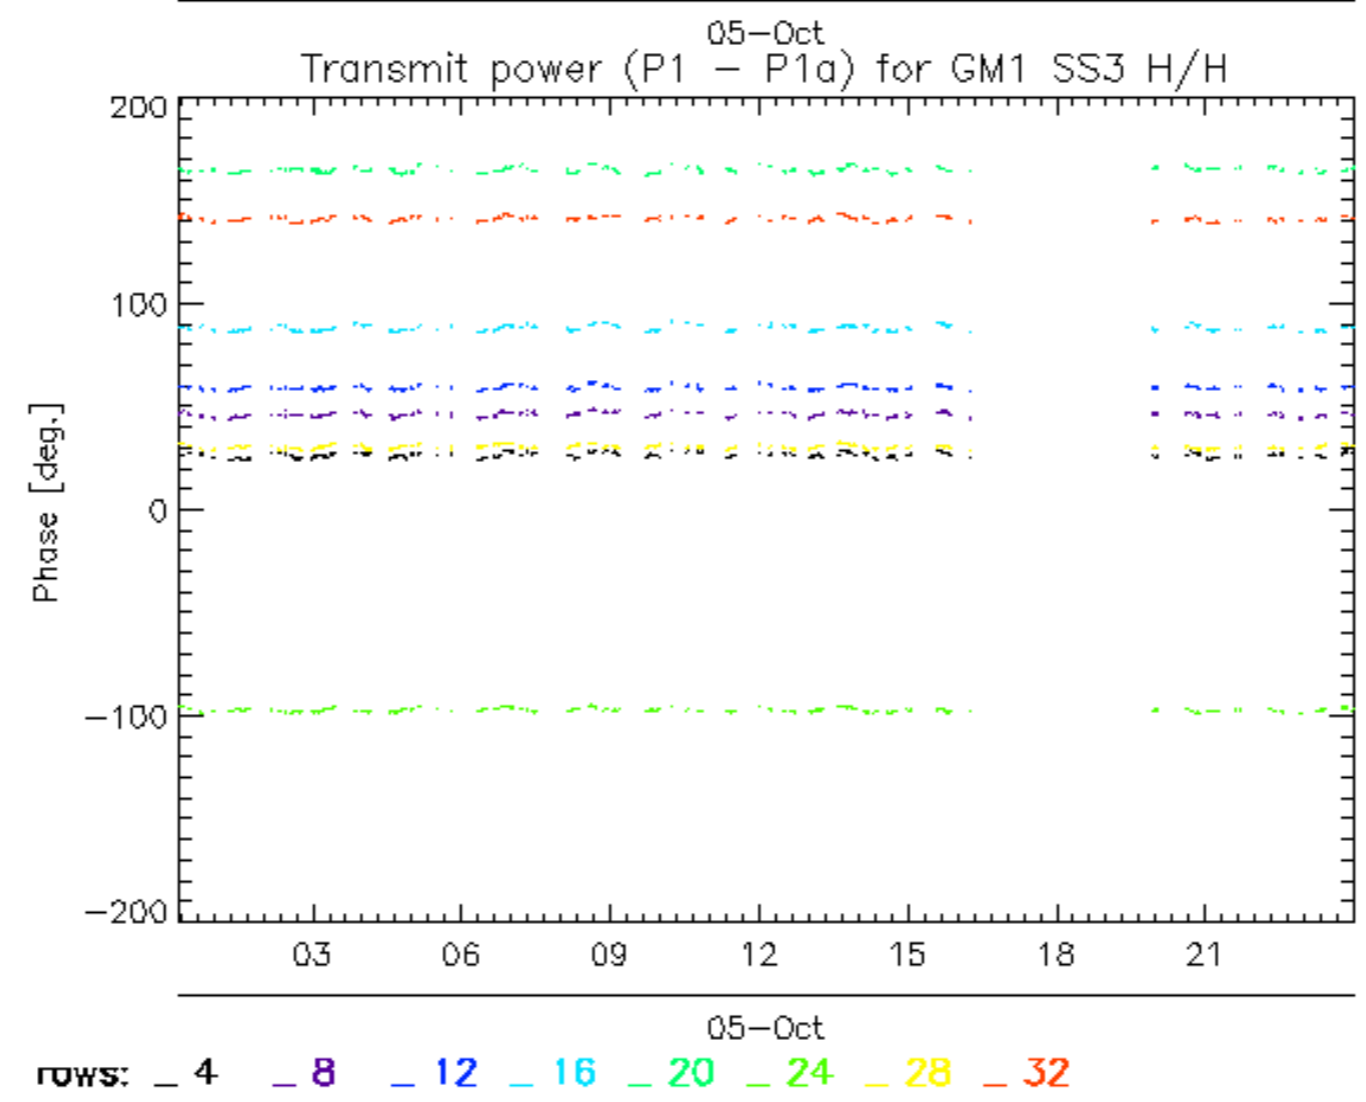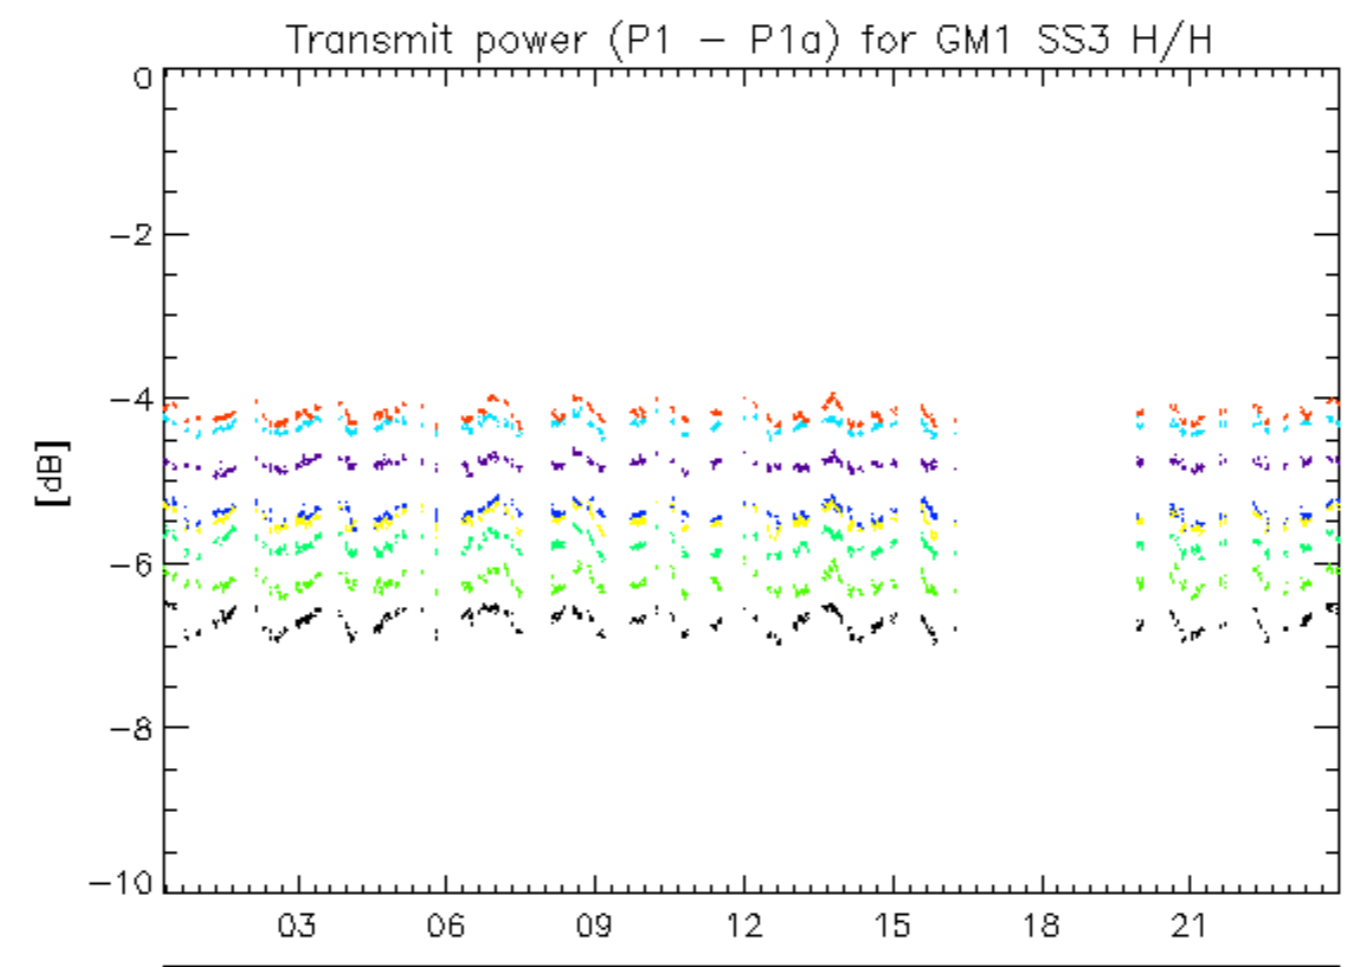


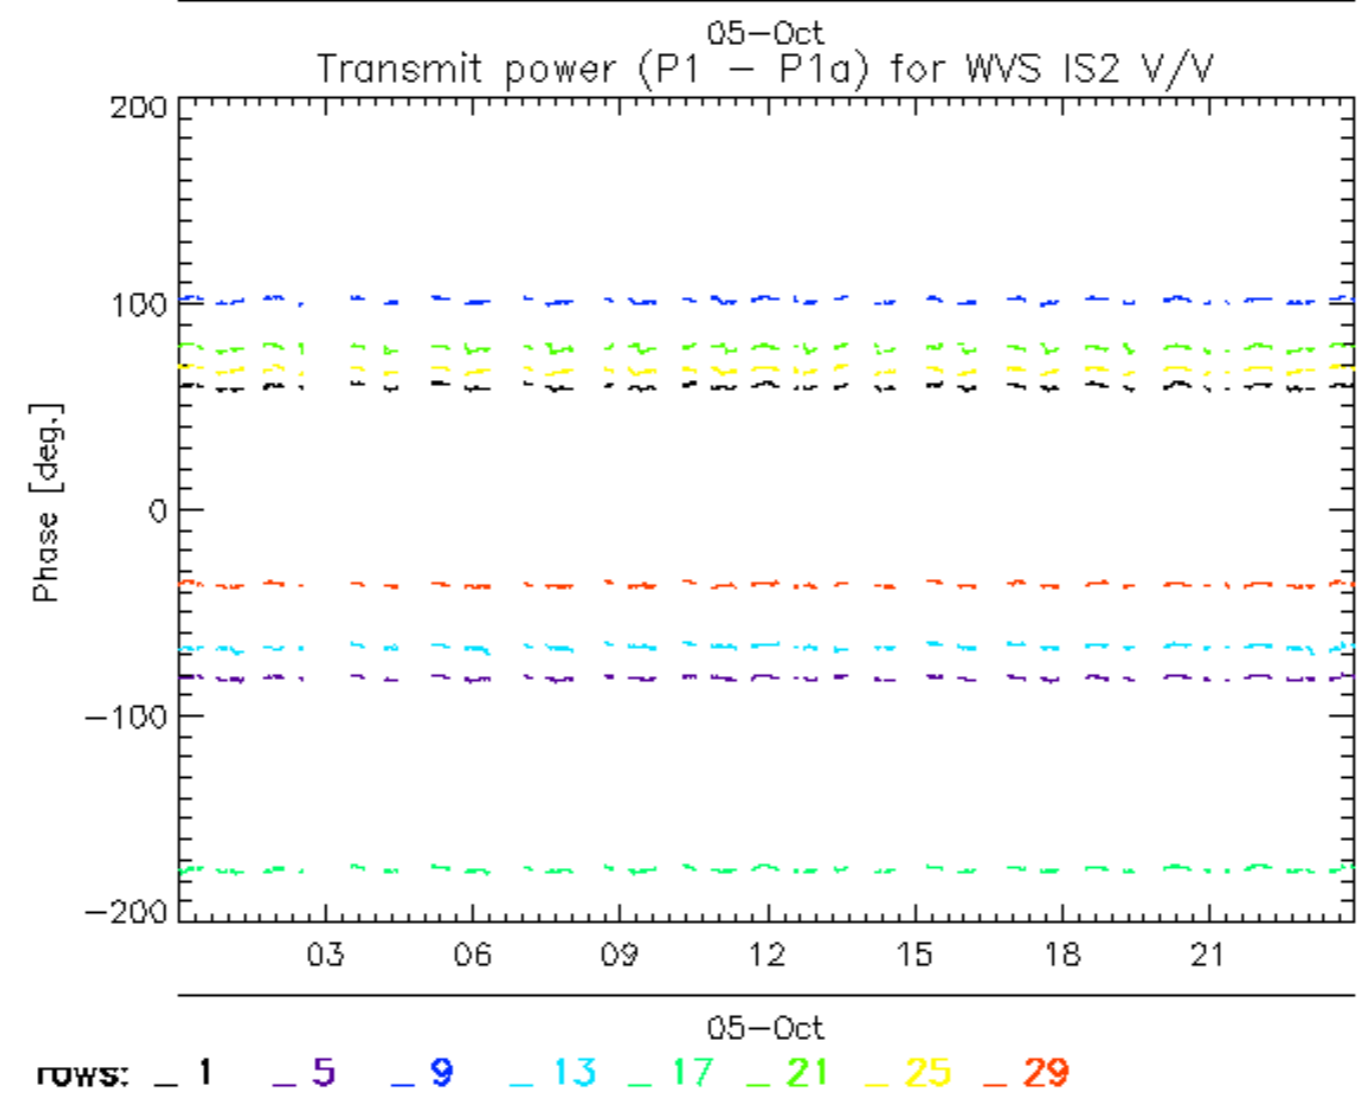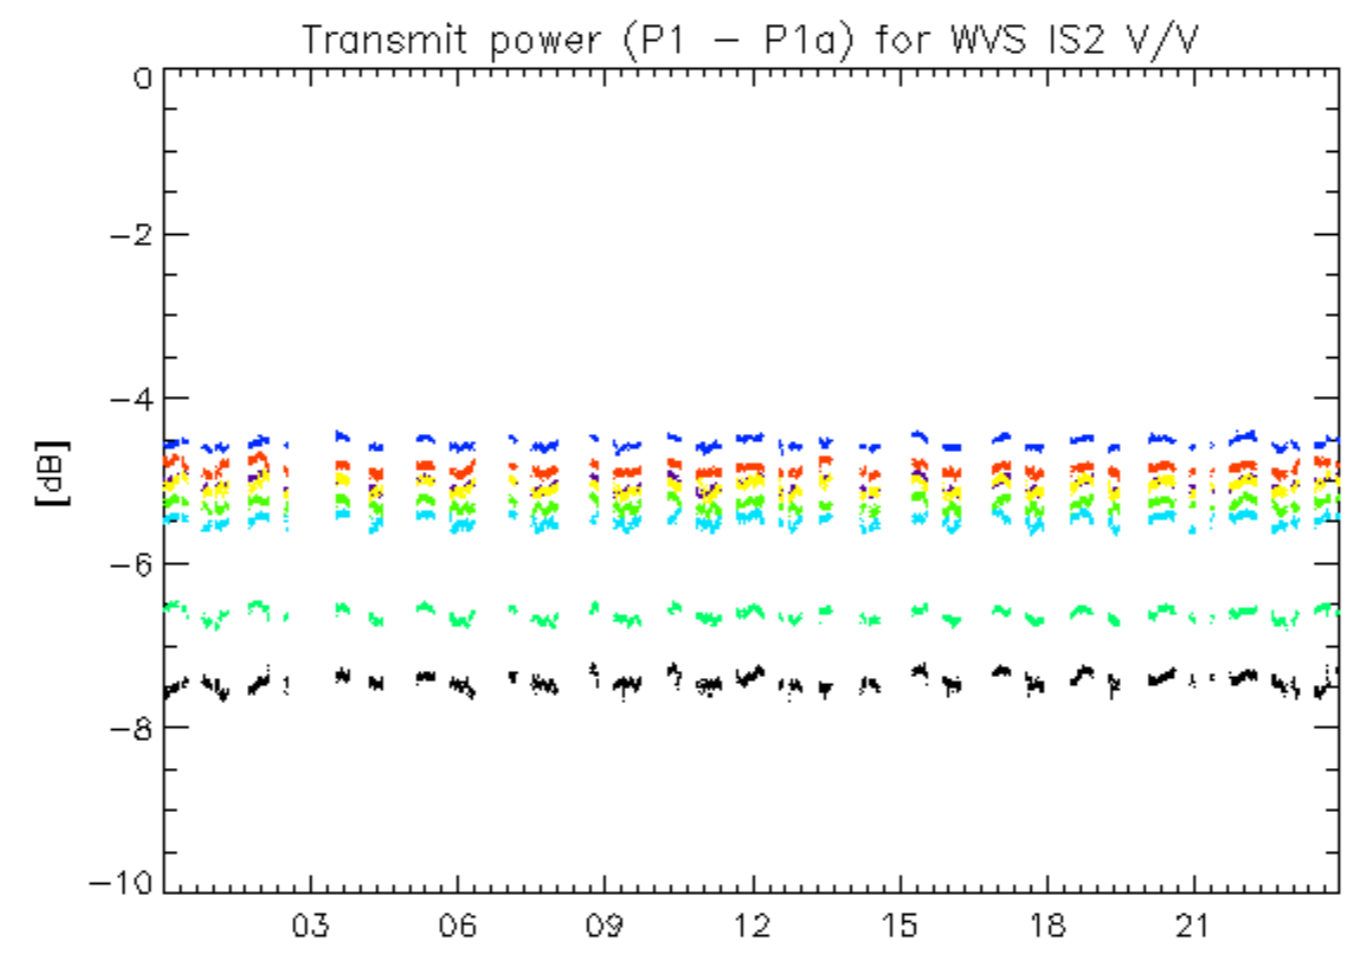


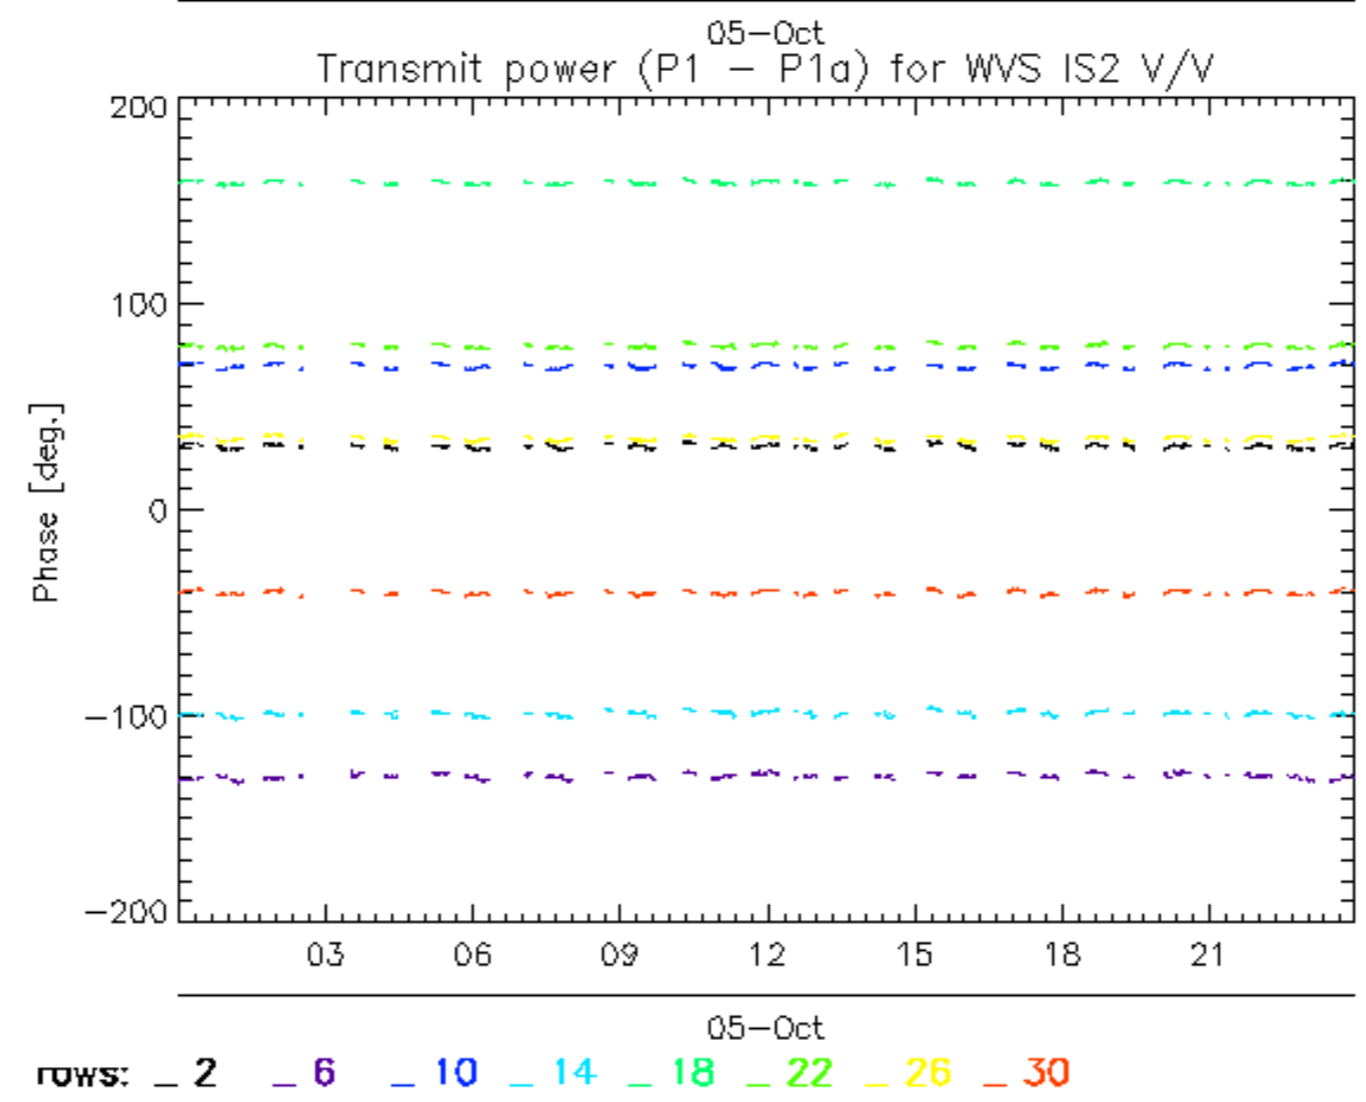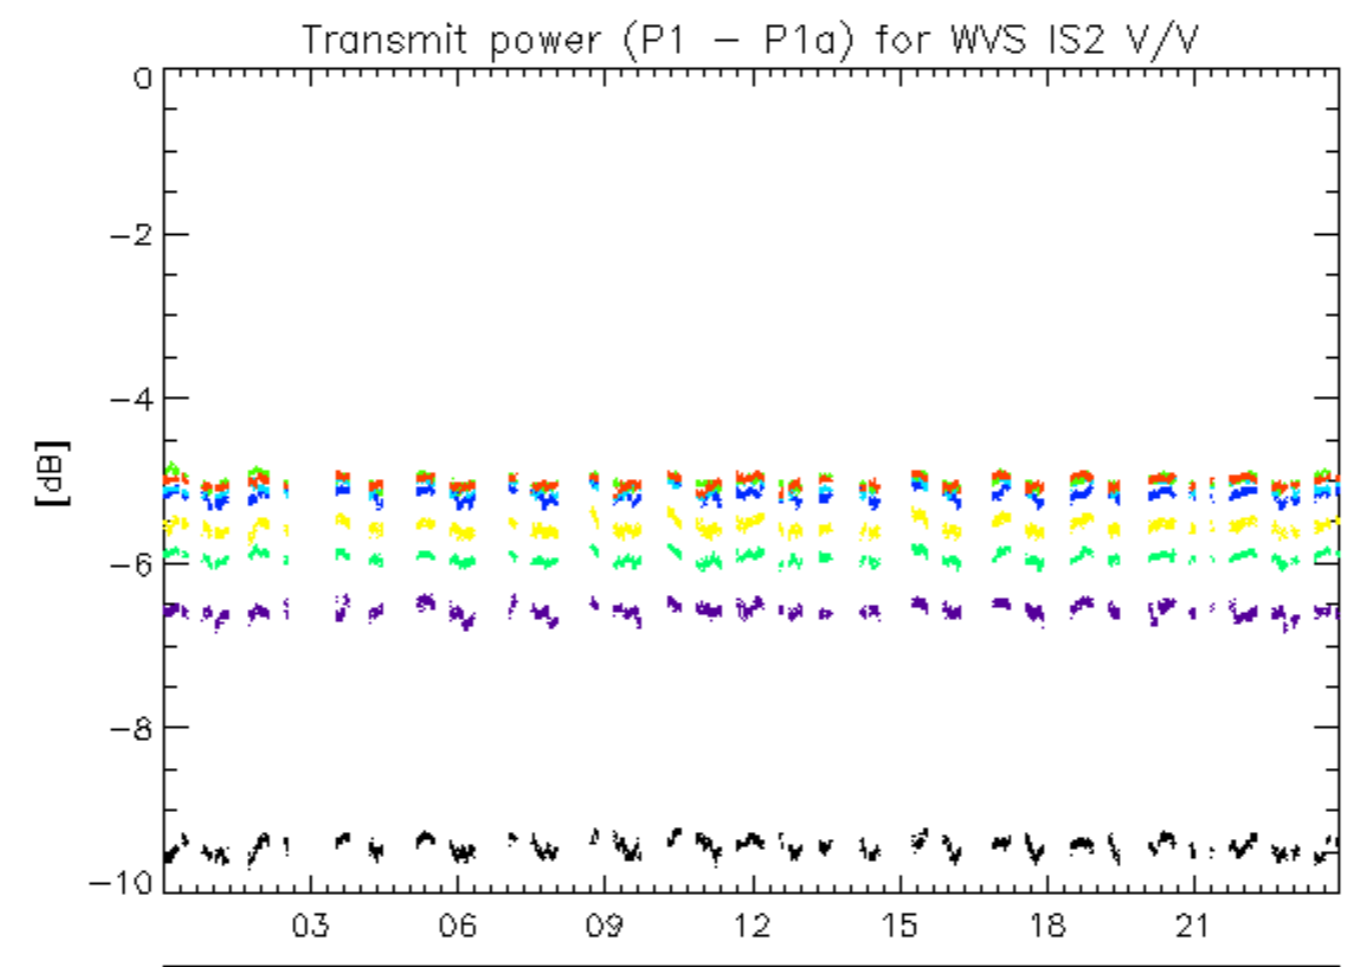


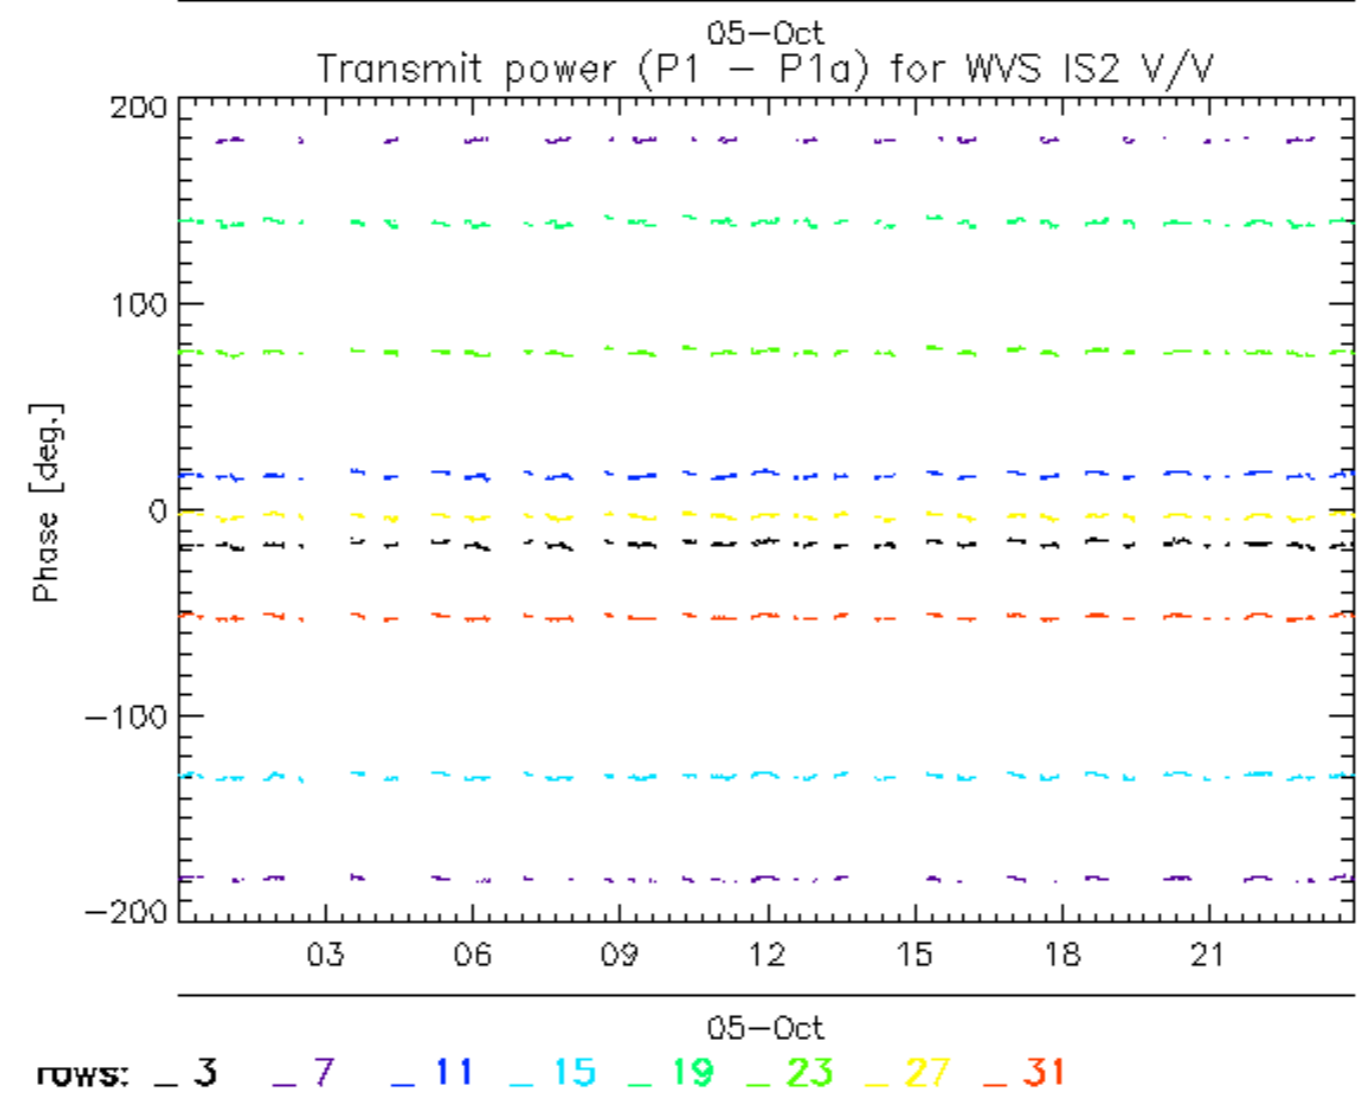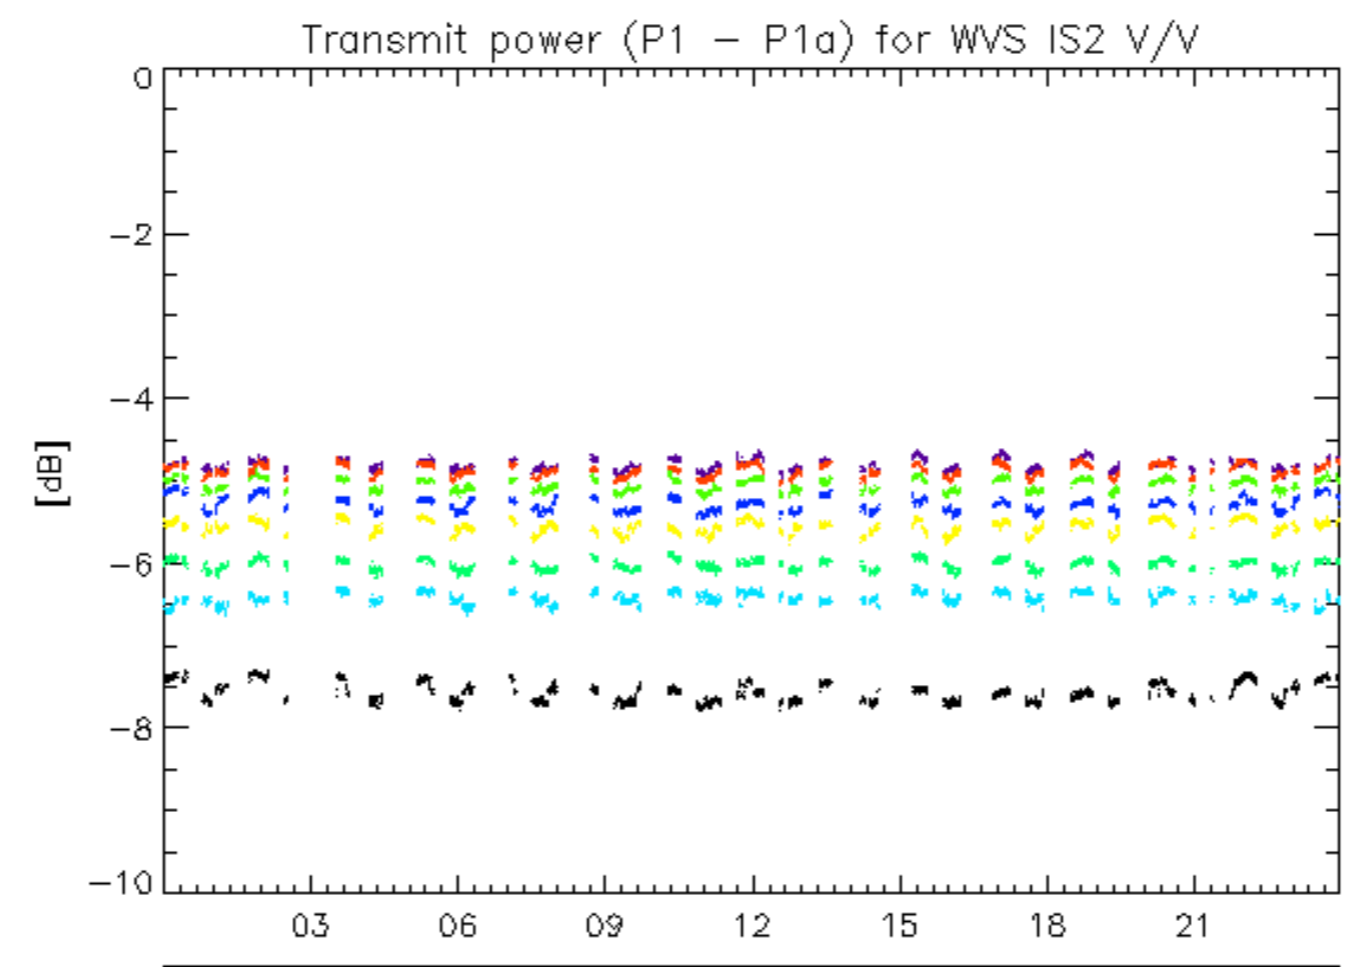


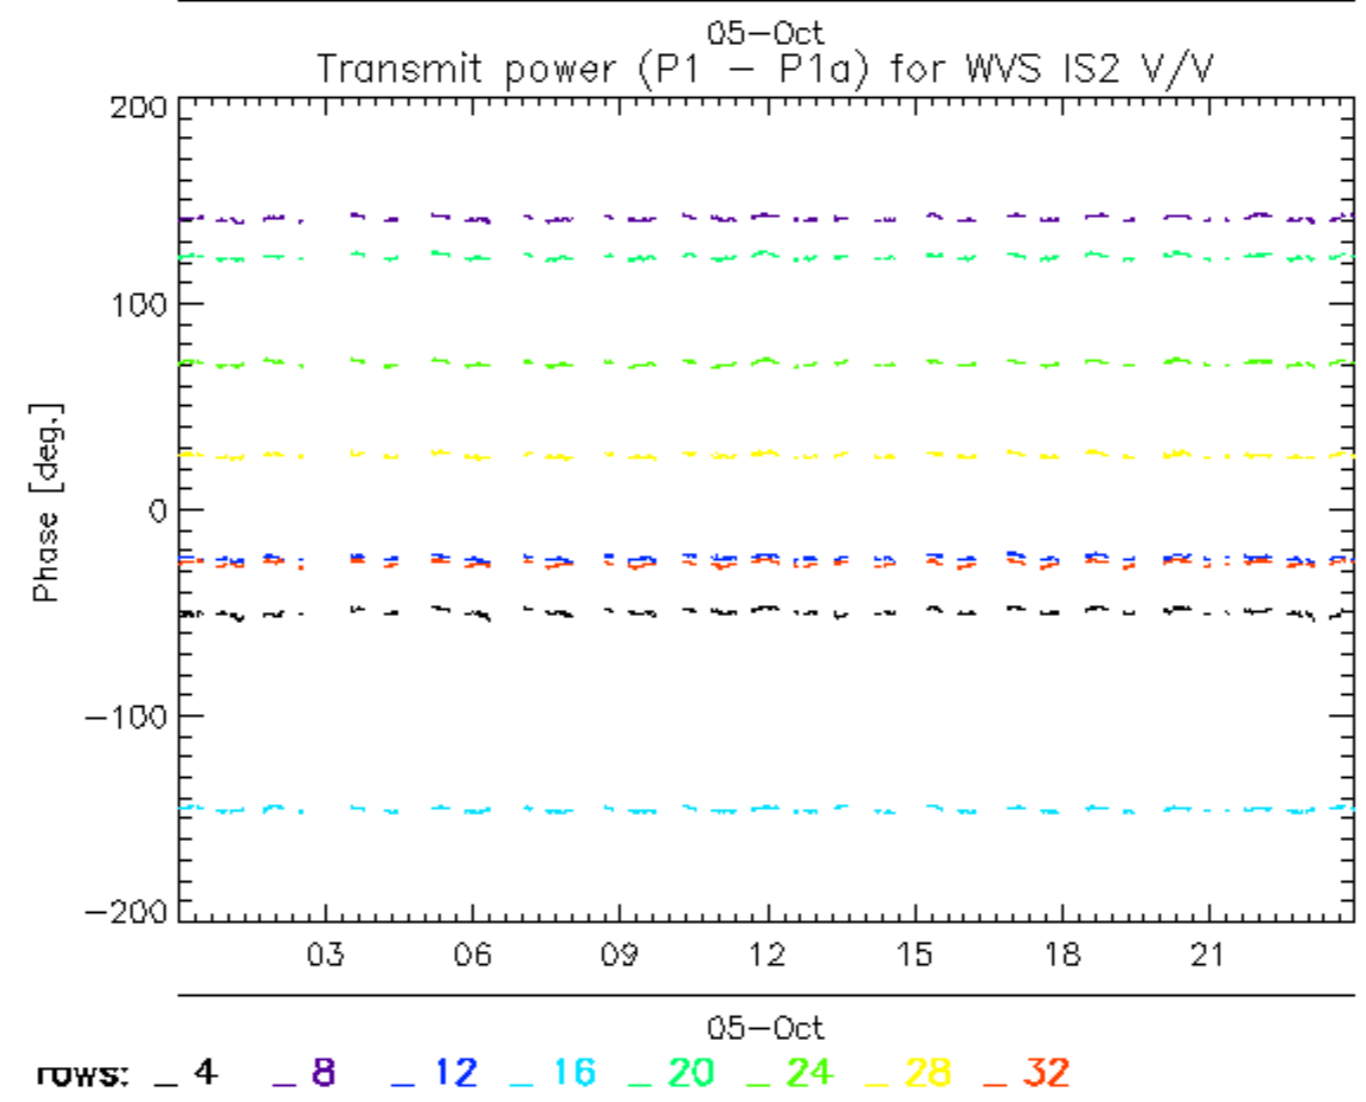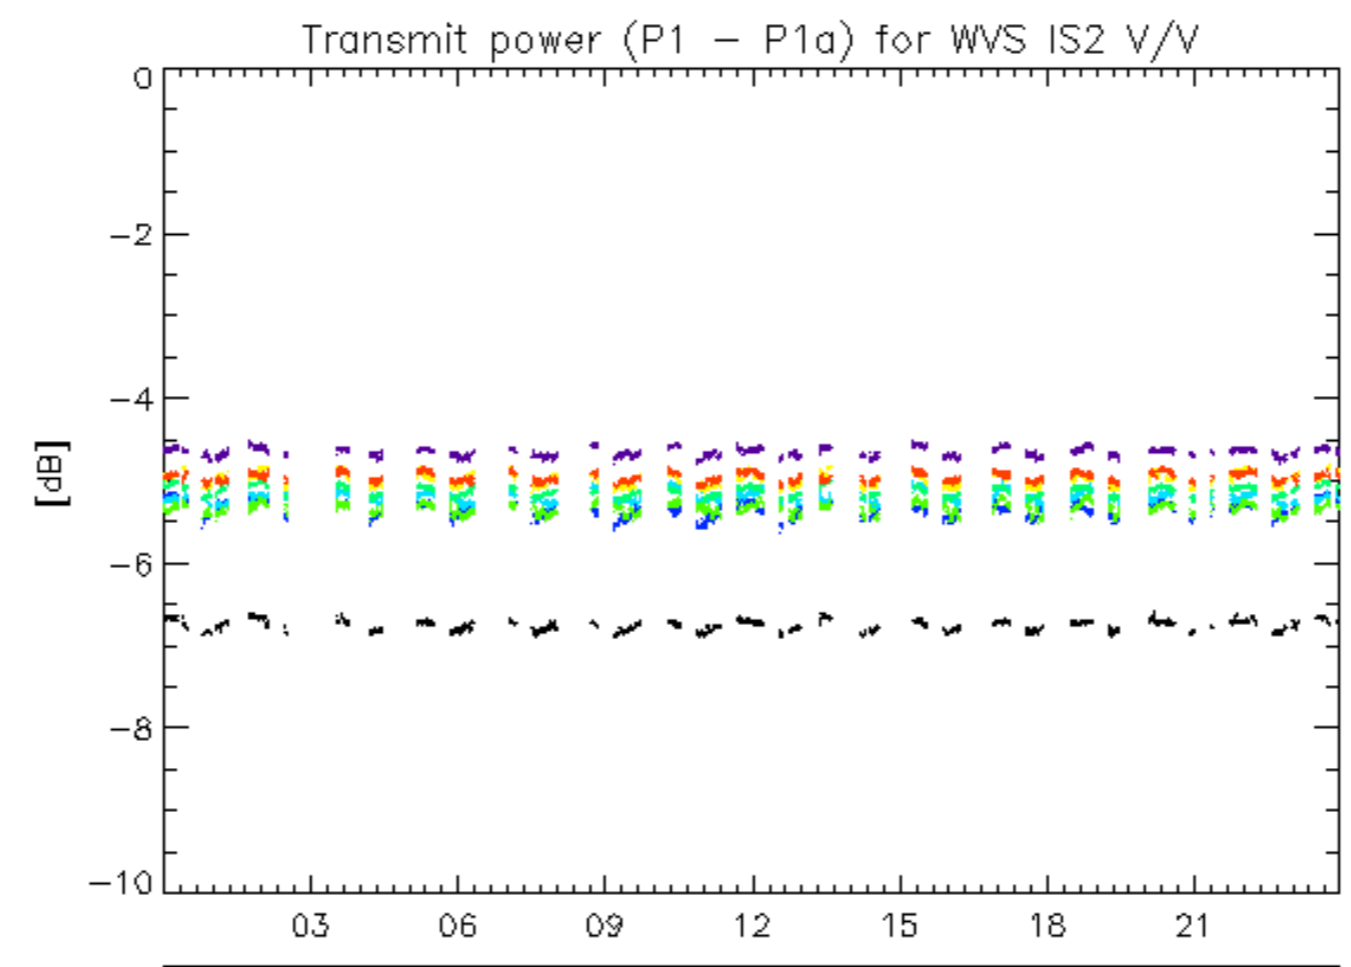

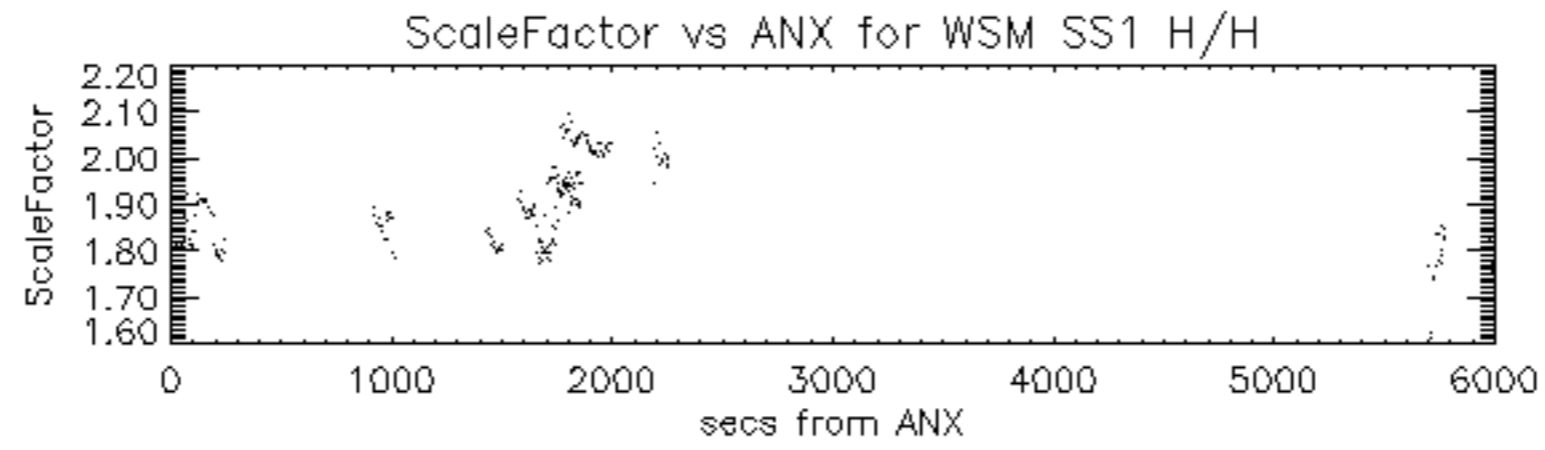

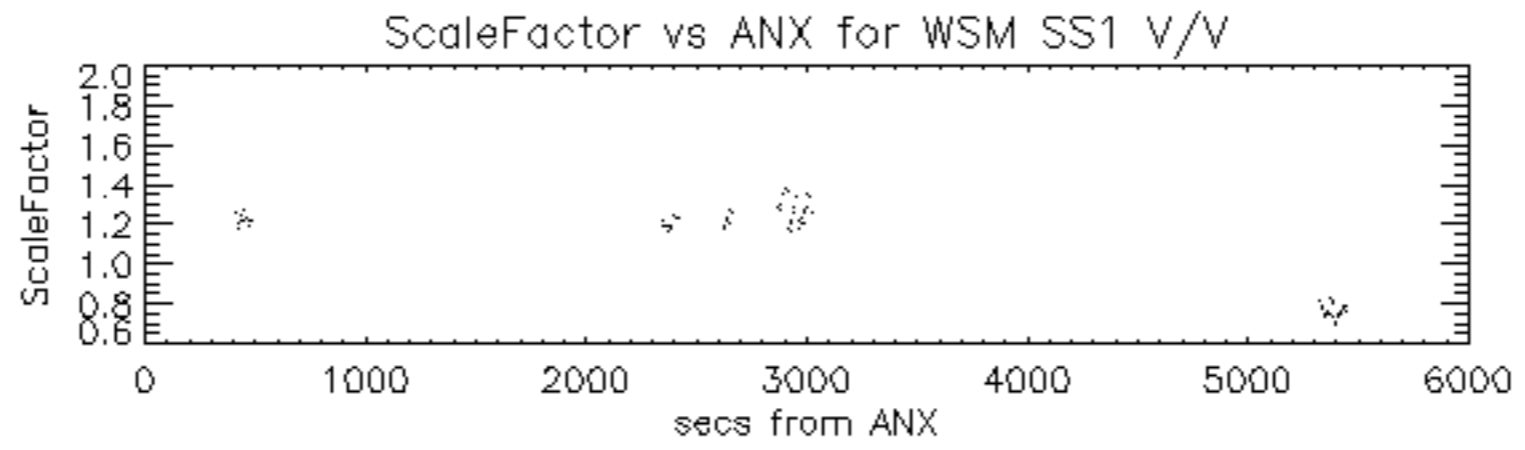

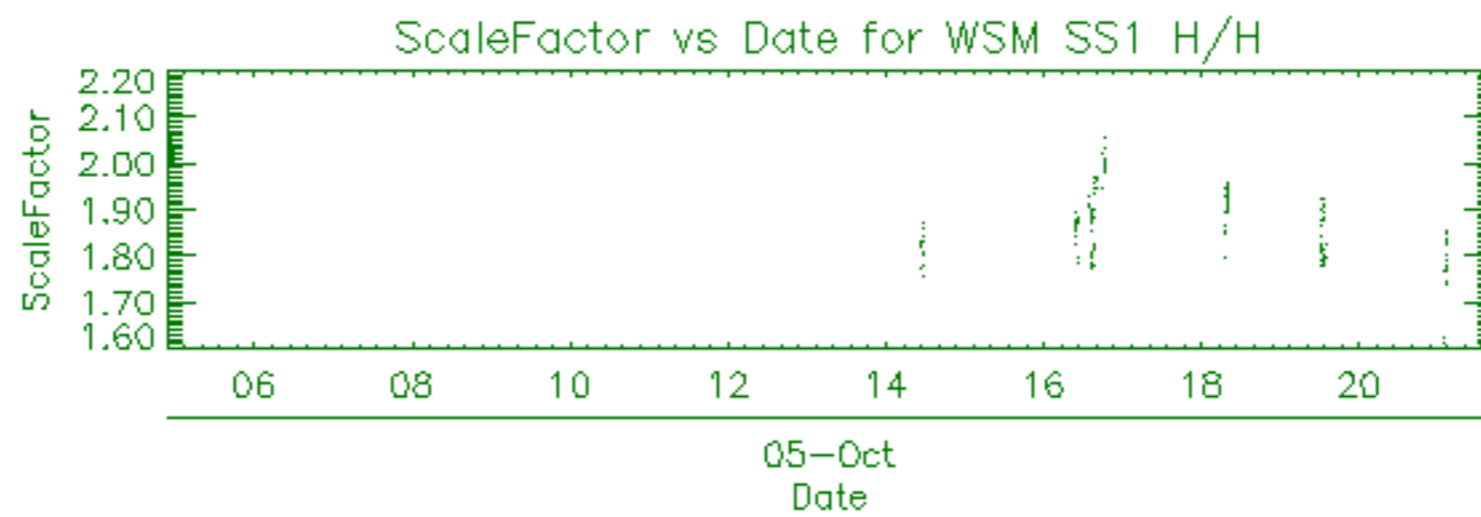

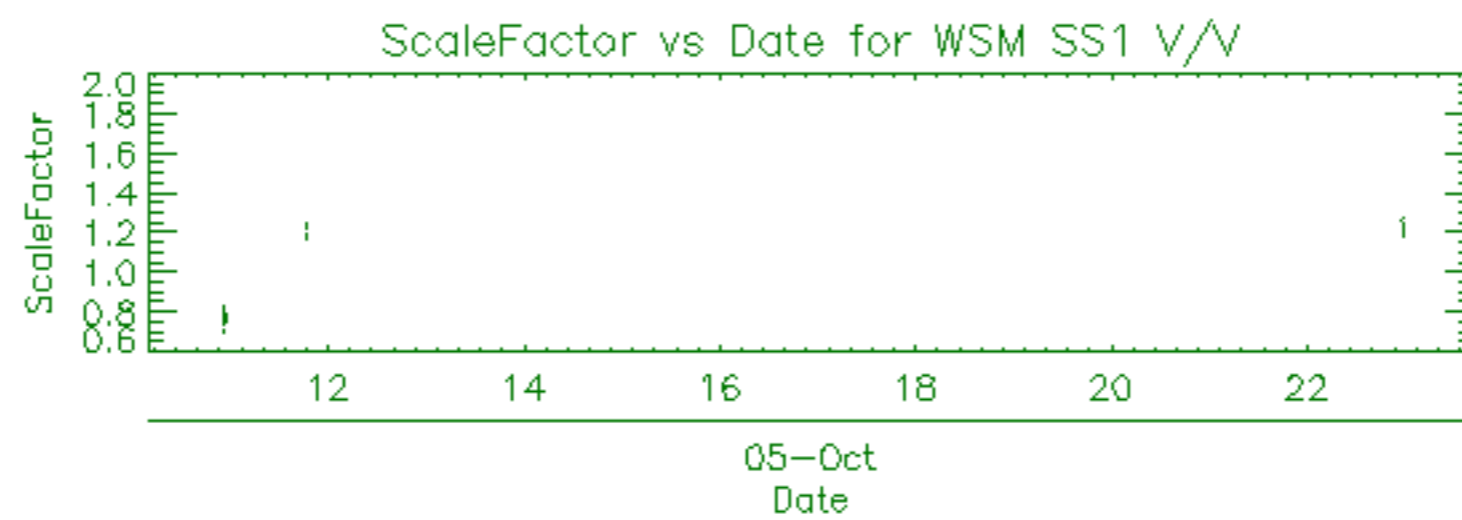

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_APM_1PNPDE20081005_101131_000001122072_00380_34502_1060.N1						IS2	H/V	72	34502	380	4.07
ASA_APM_1PNPDE20081005_143404_000000432072_00383_34505_1122.N1						IS6	H/H	72	34505	383	4.07

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_GM1_1PNPDE20081005_001753_000003082072_00374_34496_0242.N1						SS1	H/H	72	34496	374	4.07
ASA_GM1_1PNPDE20081005_002848_000002052072_00374_34496_0240.N1						SS1	H/H	72	34496	374	4.07
ASA_GM1_1PNPDE20081005_004426_000002052072_00374_34496_0250.N1						SS1	H/H	72	34496	374	4.07
ASA_GM1_1PNPDE20081005_005812_000002772072_00374_34496_0387.N1						SS1	H/H	72	34496	374	4.07
ASA_GM1_1PNPDE20081005_011903_000003022072_00375_34497_0385.N1						SS1	H/H	72	34497	375	4.07
ASA_GM1_1PNPDE20081005_012711_000010152072_00375_34497_0479.N1						SS1	H/H	72	34497	375	4.07
ASA_GM1_1PNPDE20081005_020924_000001382072_00375_34497_0551.N1						SS1	H/H	72	34497	375	4.07
ASA_GM1_1PNPDE20081005_021916_000000902072_00375_34497_0549.N1						SS1	H/H	72	34497	375	4.07
ASA_GM1_1PNPDE20081005_022533_000001692072_00375_34497_0547.N1						SS1	H/H	72	34497	375	4.07
ASA_GM1_1PNPDE20081005_023300_000004952072_00375_34497_0553.N1						SS1	H/H	72	34497	375	4.07
ASA_GM1_1PNPDE20081005_024241_000002472072_00375_34497_0555.N1						SS1	H/H	72	34497	375	4.07
ASA_GM1_1PNPDE20081005_025701_000004652072_00376_34498_0557.N1						SS1	H/H	72	34498	376	4.07
ASA_GM1_1PNPDE20081005_030535_000007432072_00376_34498_0581.N1						SS1	H/H	72	34498	376	4.07
ASA_GM1_1PNPDE20081005_031958_000004772072_00376_34498_0579.N1						SS1	H/H	72	34498	376	4.07
ASA_GM1_1PNPDE20081005_035048_000001082072_00376_34498_0722.N1						SS1	H/H	72	34498	376	4.07
ASA_GM1_1PNPDE20081005_035755_000007612072_00376_34498_0727.N1						SS1	H/H	72	34498	376	4.07
ASA_GM1_1PNPDE20081005_043303_000006102072_00377_34499_0729.N1						SS1	H/H	72	34499	377	4.07
ASA_GM1_1PNPDE20081005_044451_000005492072_00377_34499_0759.N1						SS1	H/H	72	34499	377	4.07
ASA_GM1_1PNPDE20081005_045812_000002172072_00377_34499_0734.N1						SS1	H/H	72	34499	377	4.07
ASA_GM1_1PNPDE20081005_050605_000002352072_00377_34499_0761.N1						SS1	H/H	72	34499	377	4.07
ASA_GM1_1PNPDE20081005_053036_000000842072_00377_34499_0901.N1						SS1	H/H	72	34499	377	4.07
ASA_GM1_1PNPDE20081005_054619_000001992072_00377_34499_0899.N1						SS1	H/H	72	34499	377	4.07
ASA_GM1_1PNPDE20081005_061916_000001632072_00378_34500_0903.N1						SS1	H/H	72	34500	378	4.07
ASA_GM1_1PNPDE20081005_062246_000005922072_00378_34500_0937.N1						SS1	H/H	72	34500	378	4.07
ASA_GM1_1PNPDE20081005_063840_000002052072_00378_34500_0933.N1						SS1	H/H	72	34500	378	4.07
ASA_GM1_1PNPDE20081005_064334_000002712072_00378_34500_0905.N1						SS1	H/H	72	34500	378	4.07
ASA_GM1_1PNPDE20081005_064925_000004472072_00378_34500_0935.N1						SS1	H/H	72	34500	378	4.07
ASA_GM1_1PNPDE20081005_065752_000002952072_00378_34500_0939.N1						SS1	H/H	72	34500	378	4.07
ASA_GM1_1PNPDK20081005_071112_000002292072_00378_34500_6572.N1						SS1	H/H	72	34500	378	4.07
ASA_GM1_1PNPDK20081005_071935_000000902072_00378_34500_6570.N1						SS1	H/H	72	34500	378	4.07
ASA_GM1_1PNPDK20081005_072535_000002772072_00378_34500_6577.N1						SS1	H/H	72	34500	378	4.07
ASA_GM1_1PNPDK20081005_080701_000003982072_00379_34501_6584.N1						SS1	H/H	72	34501	379	4.07
ASA_GM1_1PNPDK20081005_081226_000006342072_00379_34501_6653.N1						SS1	H/H	72	34501	379	4.07
ASA_GM1_1PNPDK20081005_083252_000005732072_00379_34501_6657.N1						SS1	H/H	72	34501	379	4.07
ASA_GM1_1PNPDK20081005_085148_000003682072_00379_34501_6655.N1						SS1	H/H	72	34501	379	4.07
ASA_GM1_1PNPDK20081005_090350_000004162072_00379_34501_6662.N1						SS1	H/H	72	34501	379	4.07
ASA_GM1_1PNPDK20081005_094348_000005312072_00380_34502_6664.N1						SS1	H/H	72	34502	380	4.07
ASA_GM1_1PNPDK20081005_095412_000001202072_00380_34502_6740.N1						SS1	H/H	72	34502	380	4.07
ASA_GM1_1PNPDK20081005_095529_000003562072_00380_34502_6792.N1						SS1	H/H	72	34502	380	4.07
ASA_GM1_1PNPDK20081005_101343_000001262072_00380_34502_6794.N1						SS1	H/H	72	34502	380	4.07
ASA_GM1_1PNPDK20081005_103224_000002232072_00380_34502_6796.N1						SS1	H/H	72	34502	380	4.07
ASA_GM1_1PNPDK20081005_104538_000003442072_00380_34502_6804.N1						SS1	H/H	72	34502	380	4.07
ASA_GM1_1PNPDK20081005_112117_000006522072_00381_34503_6806.N1						SS1	H/H	72	34503	381	4.07
ASA_GM1_1PNPDK20081005_115913_000000962072_00381_34503_6921.N1						SS1	H/H	72	34503	381	4.07
ASA_GM1_1PNPDK20081005_121300_000001992072_00381_34503_6923.N1						SS1	H/H	72	34503	381	4.07
ASA_GM1_1PNPDK20081005_122747_000002532072_00381_34503_6925.N1						SS1	H/H	72	34503	381	4.07
ASA_GM1_1PNPDK20081005_123814_000003862072_00381_34503_6933.N1						SS1	H/H	72	34503	381	4.07
ASA_GM1_1PNPDK20081005_125919_000009182072_00382_34504_6943.N1						SS1	H/H	72	34504	382	4.07
ASA_GM1_1PNPDK20081005_131328_000002652072_00382_34504_7048.N1						SS1	H/H	72	34504	382	4.07
ASA_GM1_1PNPDK20081005_133605_000006762072_00382_34504_7050.N1						SS1	H/H	72	34504	382	4.07
ASA_GM1_1PNPDK20081005_134728_000007432072_00382_34504_7052.N1						SS1	H/H	72	34504	382	4.07
ASA_GM1_1PNPDK20081005_140614_000003802072_00382_34504_7063.N1						SS1	H/H	72	34504	382	4.07
ASA_GM1_1PNPDK20081005_141833_000002652072_00382_34504_7065.N1						SS1	H/H	72	34504	382	4.07
ASA_GM1_1PNPDK20081005_143507_000007432072_00383_34505_7075.N1						SS1	H/H	72	34505	383	4.07
ASA_GM1_1PNPDK20081005_145845_000001382072_00383_34505_7181.N1						SS1	H/H	72	34505	383	4.07
ASA_GM1_1PNPDK20081005_150219_000002052072_00383_34505_7189.N1						SS1	H/H	72	34505	383	4.07
ASA_GM1_1PNPDK20081005_153411_000005792072_00383_34505_7191.N1						SS1	H/H	72	34505	383	4.07
ASA_GM1_1PNPDK20081005_154524_000004712072_00383_34505_7196.N1						SS1	H/H	72	34505	383	4.07
ASA_GM1_1PNPDK20081005_161419_000001082072_00384_34506_7198.N1						SS1	H/H	72	34506	384	4.07
ASA_GM1_1PNPDE20081005_195559_000004592072_00386_34508_1236.N1						SS1	H/H	72	34508	386	4.07
ASA_GM1_1PNPDE20081005_203559_000002352072_00386_34508_1234.N1						SS1	H/H	72	34508	386	4.07
ASA_GM1_1PNPDE20081005_204225_000001502072_00386_34508_1232.N1						SS1	H/H	72	34508	386	4.07
ASA_GM1_1PNPDE20081005_204842_000002592072_00386_34508_1254.N1						SS1	H/H	72	34508	386	4.07
ASA_GM1_1PNPDE20081005_205144_000001932072_00386_34508_1359.N1						SS1	H/H	72	34508	386	4.07
ASA_GM1_1PNPDE20081005_210050_000002412072_00386_34508_1361.N1						SS1	H/H	72	34508	386	4.07
ASA_GM1_1PNPDE20081005_210640_000005552072_00386_34508_1373.N1						SS1	H/H	72	34508	386	4.07
ASA_GM1_1PNPDE20081005_213604_000001322072_00387_34509_1371.N1						SS1	H/H	72	34509	387	4.07

ASA_GM1_1PNPDE20081005_214108_000001692072_00387_34509_1369.N1	SS1	H/H	72	34509	387	4.07
ASA_GM1_1PNPDE20081005_221635_000001812072_00387_34509_1375.N1	SS1	H/H	72	34509	387	4.07
ASA_GM1_1PNPDE20081005_222209_000002052072_00387_34509_1377.N1	SS1	H/H	72	34509	387	4.07
ASA_GM1_1PNPDE20081005_223128_000002472072_00387_34509_1382.N1	SS1	H/H	72	34509	387	4.07
ASA_GM1_1PNPDE20081005_225217_000001992072_00388_34510_1513.N1	SS1	H/H	72	34510	388	4.07
ASA_GM1_1PNPDE20081005_225636_000000842072_00388_34510_1518.N1	SS1	H/H	72	34510	388	4.07
ASA_GM1_1PNPDE20081005_231447_000006942072_00388_34510_1526.N1	SS1	H/H	72	34510	388	4.07
ASA_GM1_1PNPDE20081005_234611_000002892072_00388_34510_1531.N1	SS1	H/H	72	34510	388	4.07
ASA_GM1_1PNPDE20081005_235104_000000902072_00388_34510_1535.N1	SS1	H/H	72	34510	388	4.07
ASA_GM1_1PNPDE20081005_235711_000002652072_00388_34510_1533.N1	SS1	H/H	72	34510	388	4.07


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20081005_082931_000001912072_00379_34501_1030.N1						IS2	V/V	72	34501	379	4.07
ASA_IMM_1PNPDE20081005_100444_000000432072_00380_34502_1049.N1						IS2	V/V	72	34502	380	4.07
ASA_IMM_1PNPDE20081005_103607_000003972072_00380_34502_1079.N1						IS2	H/H	72	34502	380	4.07
ASA_IMM_1PNPDE20081005_104313_000001352072_00380_34502_1098.N1						IS2	H/H	72	34502	380	4.07
ASA_IMM_1PNPDE20081005_121618_000000622072_00381_34503_1100.N1						IS4	H/H	72	34503	381	4.07
ASA_IMM_1PNPDE20081005_121618_000001822072_00381_34503_1116.N1						IS4	H/H	72	34503	381	4.07
ASA_IMM_1PNPDE20081005_121821_000000592072_00381_34503_1104.N1						IS4	H/H	72	34503	381	4.07
ASA_IMM_1PNPDE20081005_135950_000003732072_00382_34504_1156.N1						IS2	H/H	72	34504	382	4.07
ASA_IMM_1PNPDE20081005_150542_000000372072_00383_34505_1124.N1						IS7	V/V	72	34505	383	4.07
ASA_IMM_1PNPDE20081005_154351_000000822072_00383_34505_1162.N1						IS2	H/H	72	34505	383	4.07
ASA_IMM_1PNPDE20081005_154454_00000192072_00383_34505_1120.N1						IS2	H/H	72	34505	383	4.07
ASA_IMM_1PNPDE20081005_161605_000000372072_00384_34506_1130.N1						IS5	V/V	72	34506	384	4.07
ASA_IMM_1PNPDE20081005_161645_000001632072_00384_34506_1158.N1						IS2	V/V	72	34506	384	4.07
ASA_IMM_1PNPDE20081005_172241_000000792072_00384_34506_1192.N1						IS2	H/H	72	34506	384	4.07
ASA_IMM_1PNPDE20081005_172738_000002372072_00384_34506_1190.N1						IS2	H/H	72	34506	384	4.07
ASA_IMM_1PNPDE20081005_175555_000001822072_00385_34507_1202.N1						IS6	V/V	72	34507	385	4.07
ASA_IMM_1PNPDE20081005_190627_000003432072_00385_34507_1225.N1						IS2	H/H	72	34507	385	4.07
ASA_IMM_1PNPDE20081005_201432_000000582072_00386_34508_1322.N1						IS5	V/V	72	34508	386	4.07
ASA_IMM_1PNPDE20081005_203952_000001392072_00386_34508_1344.N1						IS2	H/H	72	34508	386	4.07
ASA_IMM_1PNPDE20081005_204452_000002192072_00386_34508_1324.N1						IS2	H/H	72	34508	386	4.07
ASA_IMM_1PNPDE20081005_212232_000000372072_00387_34509_1458.N1						IS7	V/V	72	34509	387	4.07
ASA_IMM_1PNPDE20081005_221936_000001392072_00387_34509_1496.N1						IS2	H/H	72	34509	387	4.07
ASA_IMM_1PNPDE20081005_222536_000003422072_00387_34509_1494.N1						IS2	H/H	72	34509	387	4.07
ASA_IMM_1PNPDE20081005_225538_000000482072_00388_34510_1476.N1						IS2	V/V	72	34510	388	4.07


Filename	Pol	Timestamp	count(Module)
ASA_MS__0PNPDE20081005_053203_000000162072_00377_34499_0340.N1	V	2008-10-05 05:32:03	320





Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WSM_1PNPDE20081005_045405_000002452072_00377_34499_1032.N1						SS1	H/H	72	34499	377	4.07
ASA_WSM_1PNPDE20081005_101003_000000612072_00380_34502_1051.N1						SS1	V/V	72	34502	380	4.07
ASA_WSM_1PNPDE20081005_105507_000001352072_00380_34502_1111.N1						SS1	V/V	72	34502	380	4.07
ASA_WSM_1PNPDE20081005_114604_000000912072_00381_34503_1106.N1						SS1	V/V	72	34503	381	4.07
ASA_WSM_1PNPDE20081005_142701_000000922072_00382_34504_1160.N1						SS1	H/H	72	34504	382	4.07
ASA_WSM_1PNPDE20081005_162402_000001212072_00384_34506_1164.N1						SS1	H/H	72	34506	384	4.07
ASA_WSM_1PNPDE20081005_163503_000001832072_00384_34506_1204.N1						SS1	H/H	72	34506	384	4.07
ASA_WSM_1PNPDE20081005_163846_000000732072_00384_34506_1174.N1						SS1	H/H	72	34506	384	4.07
ASA_WSM_1PNPDE20081005_164514_000000912072_00384_34506_1200.N1						SS1	H/H	72	34506	384	4.07
ASA_WSM_1PNPDE20081005_181805_000001532072_00385_34507_1227.N1						SS1	H/H	72	34507	385	4.07
ASA_WSM_1PNPDE20081005_193026_000002382072_00386_34508_1351.N1						SS1	H/H	72	34508	386	4.07
ASA_WSM_1PNPDE20081005_210455_000001032072_00386_34508_1349.N1						SS1	H/H	72	34508	386	4.07
ASA_WSM_1PNPDE20081005_213423_000000972072_00387_34509_1498.N1						SS1	H/H	72	34509	387	4.07
ASA_WSM_1PNPDE20081005_213818_000001642072_00387_34509_1509.N1						SS1	H/H	72	34509	387	4.07
ASA_WSM_1PNPDE20081005_225804_000000922072_00388_34510_1511.N1						SS1	V/V	72	34510	388	4.07
ASA_WSM_1PNPDE20081005_233858_000001702072_00388_34510_1651.N1						SS1	V/V	72	34510	388	4.07




Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20081004_235928_000010642072_00374_34496_0238.N1						IS2	V/V	72	34496	374	4.07
ASA_WVS_1PNPDE20081005_002304_000003002072_00374_34496_0245.N1						IS2	V/V	72	34496	374	4.07
ASA_WVS_1PNPDE20081005_004751_000002552072_00374_34496_0248.N1						IS2	V/V	72	34496	374	4.07
ASA_WVS_1PNPDE20081005_005121_000003742072_00374_34496_0380.N1						IS2	V/V	72	34496	374	4.07
ASA_WVS_1PNPDE20081005_010251_000007342072_00374_34496_0383.N1						IS2	V/V	72	34496	374	4.07
ASA_WVS_1PNPDE20081005_011715_00000602072_00375_34497_0390.N1						IS2	V/V	72	34497	375	4.07
ASA_WVS_1PNPDE20081005_014405_000001642072_00375_34497_0393.N1						IS2	V/V	72	34497	375	4.07
ASA_WVS_1PNPDE20081005_014758_000003142072_00375_34497_0396.N1						IS2	V/V	72	34497	375	4.07
ASA_WVS_1PNPDE20081005_015447_000008392072_00375_34497_0412.N1						IS2	V/V	72	34497	375	4.07
ASA_WVS_1PNPDE20081005_020832_000000152072_00375_34497_0545.N1						IS2	V/V	72	34497	375	4.07
ASA_WVS_1PNPDE20081005_022827_000002252072_00375_34497_0577.N1						IS2	V/V	72	34497	375	4.07
ASA_WVS_1PNPDE20081005_033025_000008392072_00376_34498_0584.N1						IS2	V/V	72	34498	376	4.07
ASA_WVS_1PNPDE20081005_034410_000001952072_00376_34498_0720.N1						IS2	V/V	72	34498	376	4.07
ASA_WVS_1PNPDE20081005_041041_000001202072_00376_34498_0717.N1						IS2	V/V	72	34498	376	4.07
ASA_WVS_1PNPDE20081005_041449_000004792072_00376_34498_0725.N1						IS2	V/V	72	34498	376	4.07
ASA_WVS_1PNPDE20081005_042455_000001642072_00377_34499_0732.N1						IS2	V/V	72	34499	377	4.07
ASA_WVS_1PNPDE20081005_051004_000009892072_00377_34499_0775.N1						IS2	V/V	72	34499	377	4.07
ASA_WVS_1PNPDE20081005_052618_000002102072_00377_34499_0897.N1						IS2	V/V	72	34499	377	4.07
ASA_WVS_1PNPDE20081005_051004_000009892072_00377_34499_0775.N1						IS1	V/V	72	34499	377	4.07
ASA_WVS_1PNPDE20081005_054939_000017392072_00377_34499_0943.N1						IS2	V/V	72	34499	377	4.07
ASA_WVS_1PNPDE20081005_070251_000001802072_00378_34500_0931.N1						IS2	V/V	72	34500	378	4.07
ASA_WVS_1PNPDK20081005_070536_000002852072_00378_34500_6575.N1						IS2	V/V	72	34500	378	4.07
ASA_WVS_1PNPDK20081005_073015_000017992072_00378_34500_6610.N1						IS2	V/V	72	34500	378	4.07
ASA_WVS_1PNPDK20081005_084225_000005252072_00379_34501_6660.N1						IS2	V/V	72	34501	379	4.07
ASA_WVS_1PNPDK20081005_091051_000019342072_00379_34501_6738.N1						IS2	V/V	72	34501	379	4.07
ASA_WVS_1PNPDK20081005_101549_000009442072_00380_34502_6802.N1						IS2	V/V	72	34502	380	4.07
ASA_WVS_1PNPDK20081005_105126_000001802072_00380_34502_6799.N1						IS2	V/V	72	34502	380	4.07
ASA_WVS_1PNPDK20081005_105730_000013792072_00380_34502_6809.N1						IS2	V/V	72	34502	380	4.07
ASA_WVS_1PNPDK20081005_114031_000002852072_00381_34503_6916.N1						IS2	V/V	72	34503	381	4.07
ASA_WVS_1PNPDK20081005_114733_000006592072_00381_34503_6919.N1						IS2	V/V	72	34503	381	4.07
ASA_WVS_1PNPDK20081005_120053_000006892072_00381_34503_6928.N1						IS2	V/V	72	34503	381	4.07
ASA_WVS_1PNPDK20081005_123202_000002552072_00381_34503_6931.N1						IS2	V/V	72	34503	381	4.07
ASA_WVS_1PNPDK20081005_124440_000008402072_00381_34503_6941.N1						IS2	V/V	72	34503	381	4.07
ASA_WVS_1PNPDK20081005_132111_000008542072_00382_34504_7055.N1						IS2	V/V	72	34504	382	4.07
ASA_WVS_1PNPDK20081005_141238_000003152072_00382_34504_7061.N1						IS2	V/V	72	34504	382	4.07
ASA_WVS_1PNPDK20081005_142259_000001942072_00382_34504_7058.N1						IS2	V/V	72	34504	382	4.07
ASA_WVS_1PNPDK20081005_142831_000002992072_00383_34505_7068.N1						IS2	V/V	72	34505	383	4.07
ASA_WVS_1PNPDK20081005_151547_000010642072_00383_34505_7194.N1						IS2	V/V	72	34505	383	4.07
ASA_WVS_1PNPDK20081005_155314_000012142072_00383_34505_7203.N1						IS2	V/V	72	34505	383	4.07
ASA_WVS_1PNPDK20081005_165411_000011992072_00384_34506_7330.N1						IS2	V/V	72	34506	384	4.07
ASA_WVS_1PNPDK20081005_173350_000012892072_00384_34506_7340.N1						IS2	V/V	72	34506	384	4.07
ASA_WVS_1PNPDK20081005_182903_000015292072_00385_34507_7454.N1						IS2	V/V	72	34507	385	4.07
ASA_WVS_1PNPDK20081005_191426_000008392072_00385_34507_7466.N1						IS2	V/V	72	34507	385	4.07
ASA_WVS_1PNPDE20081005_200342_000006142072_00386_34508_1230.N1						IS2	V/V	72	34508	386	4.07
ASA_WVS_1PNPDE20081005_201536_000011842072_00386_34508_1247.N1						IS2	V/V	72	34508	386	4.07
ASA_WVS_1PNPDE20081005_205502_000003002072_00386_34508_1364.N1						IS2	V/V	72	34508	386	4.07
ASA_WVS_1PNPDE20081005_212048_000000592072_00387_34509_1367.N1						IS2	V/V	72	34509	387	4.07
ASA_WVS_1PNPDE20081005_214402_000019042072_00387_34509_1380.N1						IS2	V/V	72	34509	387	4.07
ASA_WVS_1PNPDE20081005_223538_000001652072_00387_34509_1385.N1						IS2	V/V	72	34509	387	4.07
ASA_WVS_1PNPDE20081005_223723_000008542072_00387_34509_1516.N1						IS2	V/V	72	34509	387	4.07
ASA_WVS_1PNPDE20081005_225934_000004042072_00388_34510_1521.N1						IS2	V/V	72	34510	388	4.07
ASA_WVS_1PNPDE20081005_232626_000007042072_00388_34510_1524.N1						IS2	V/V	72	34510	388	4.07
ASA_WVS_1PNPDE20081005_234148_000002242072_00388_34510_1529.N1						IS2	V/V	72	34510	388	4.07
ASA_WVS_1PNPDE20081005_235236_000002252072_00388_34510_1540.N1						IS2	V/V	72	34510	388	4.07



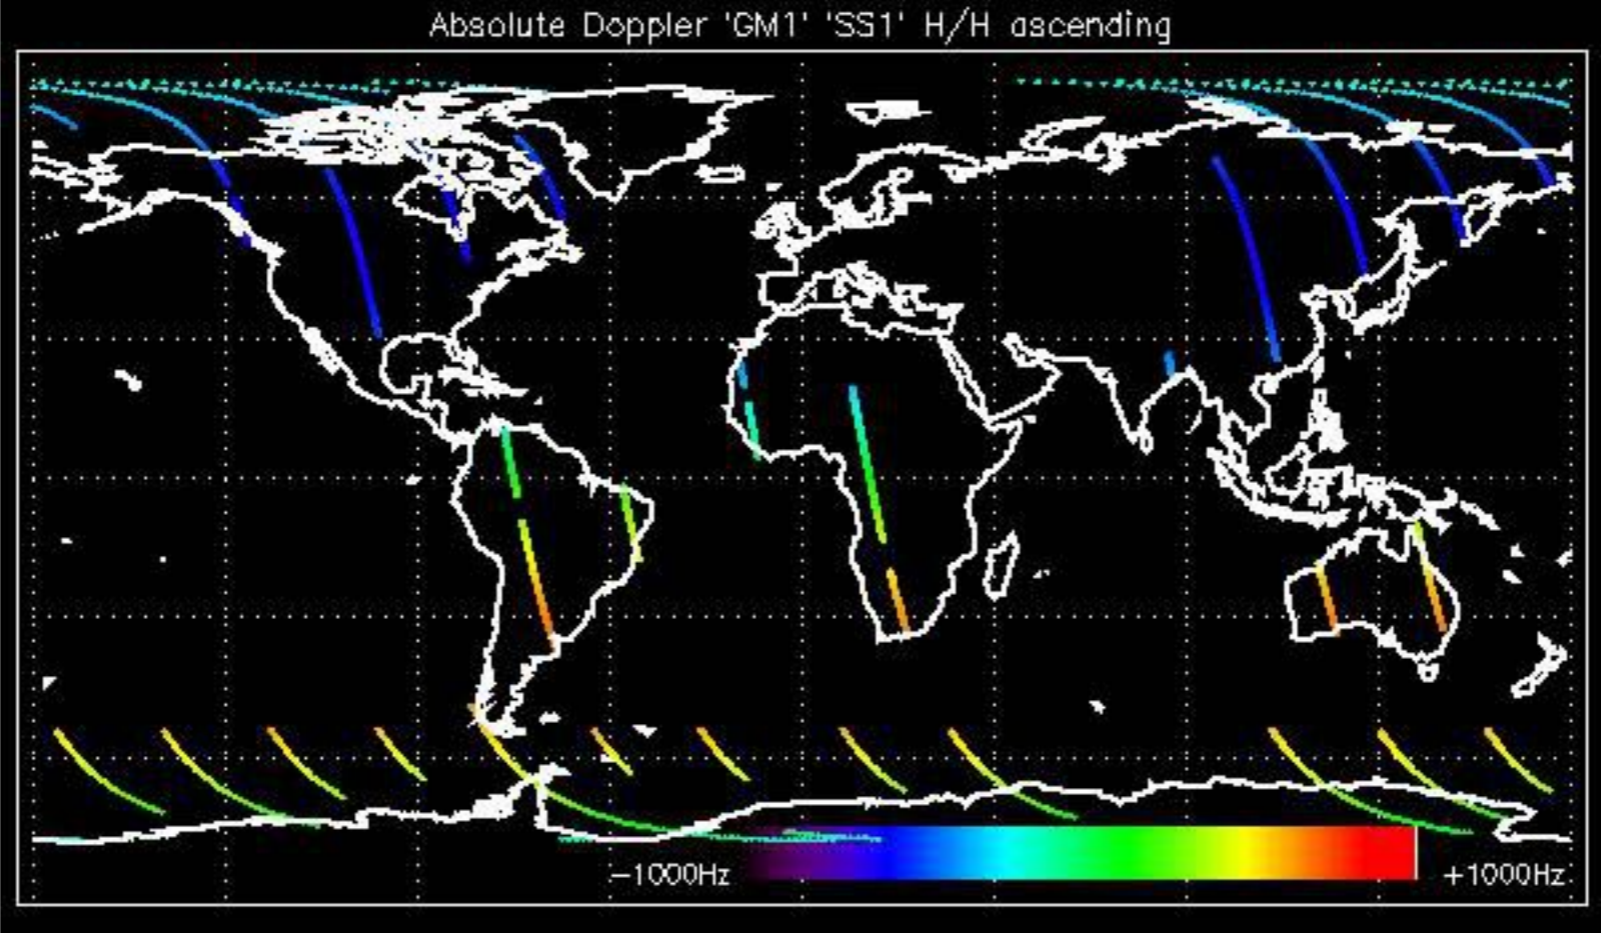


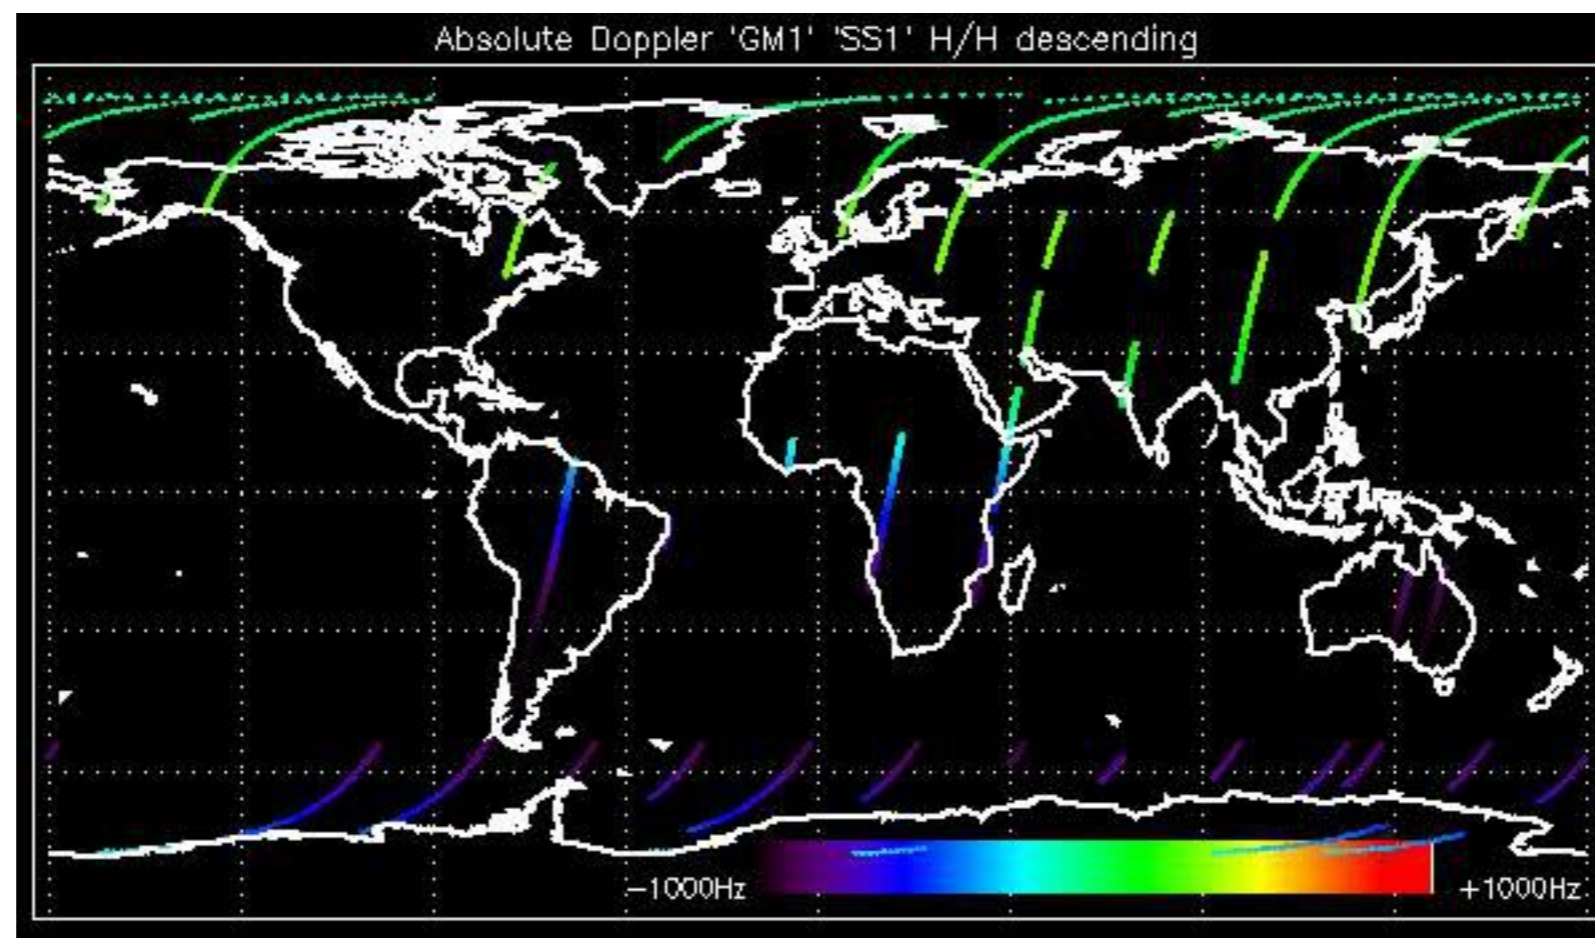


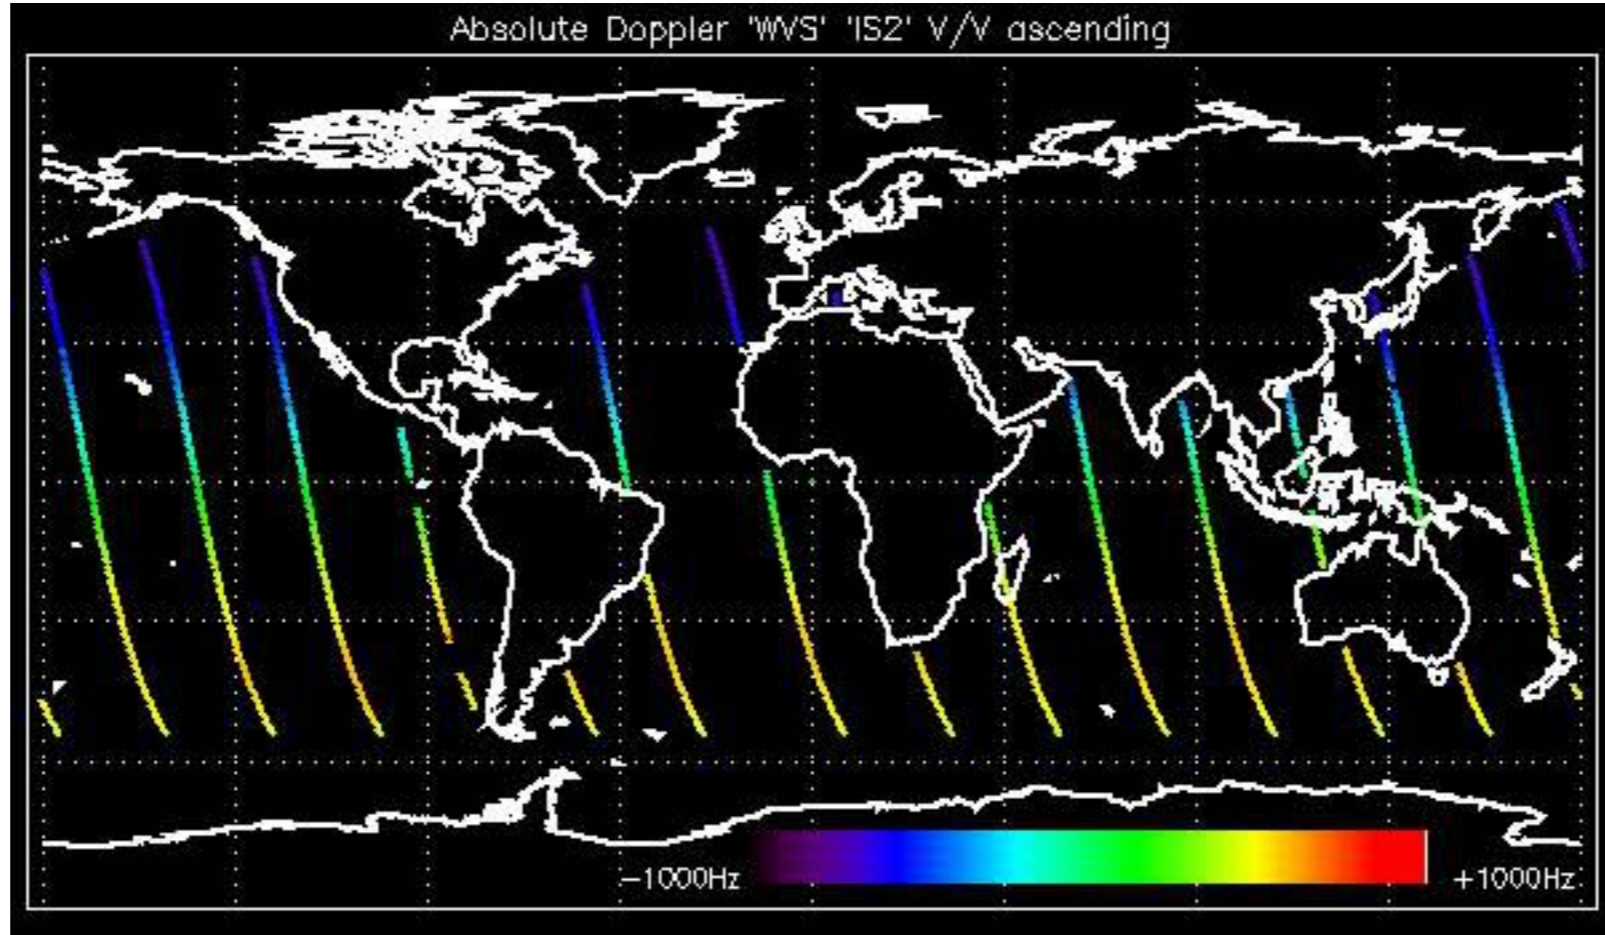


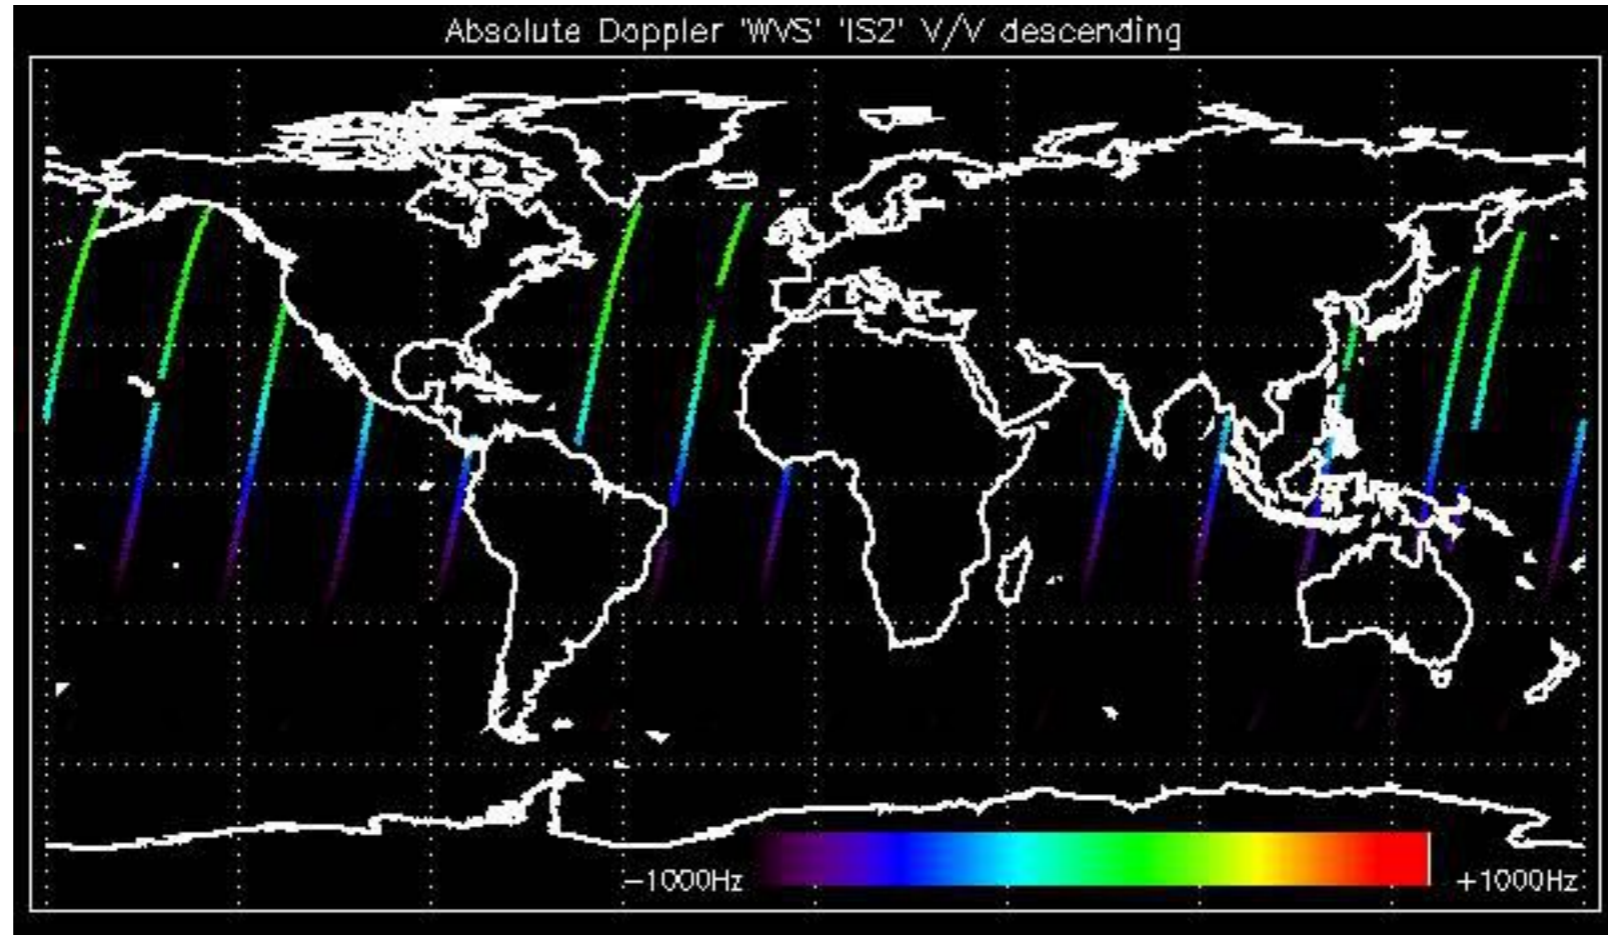


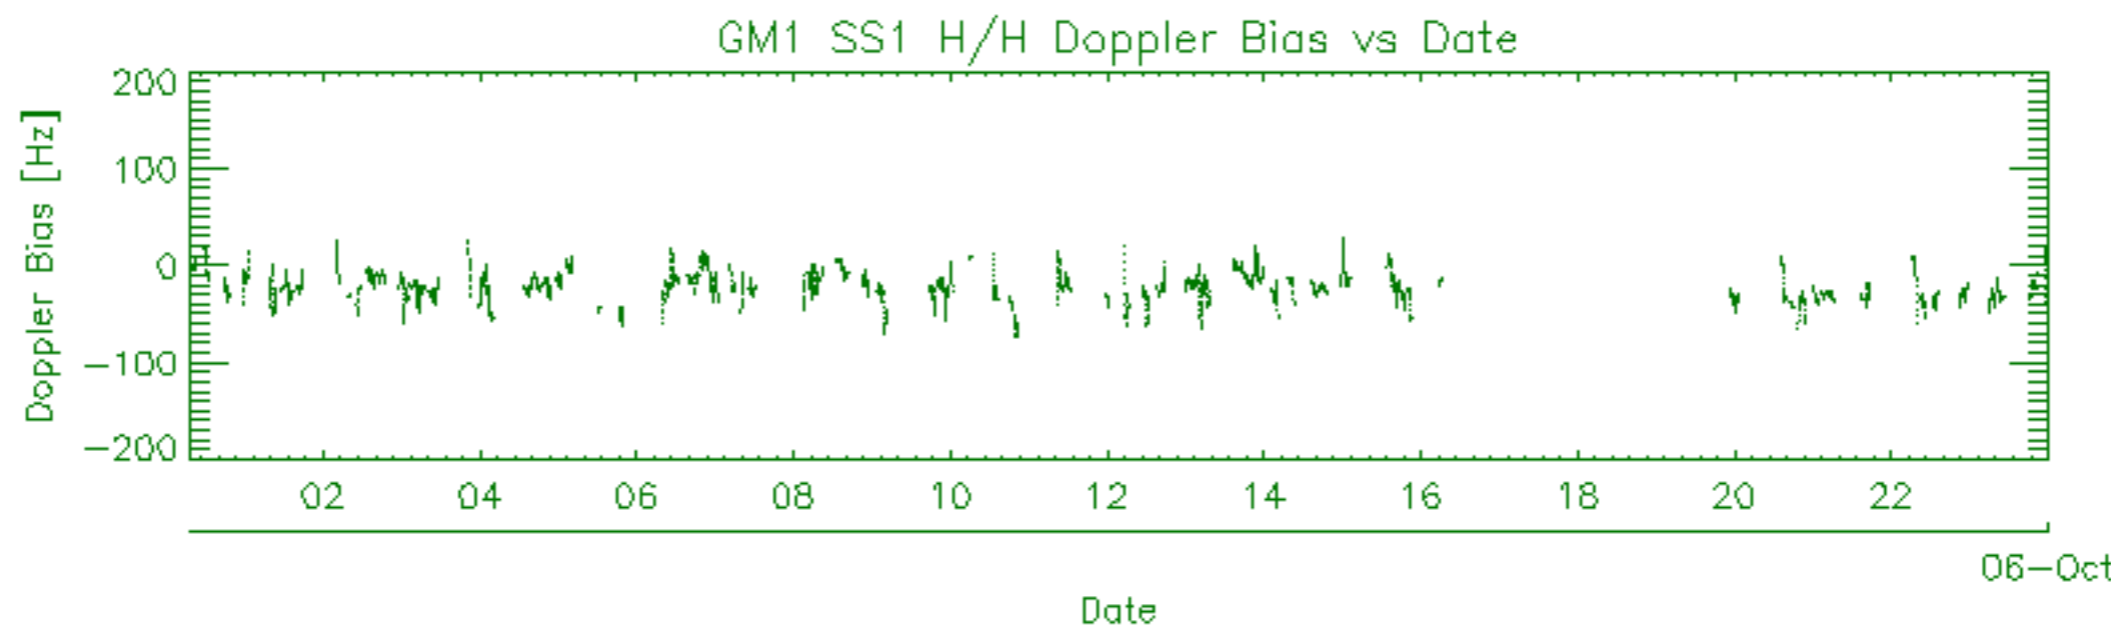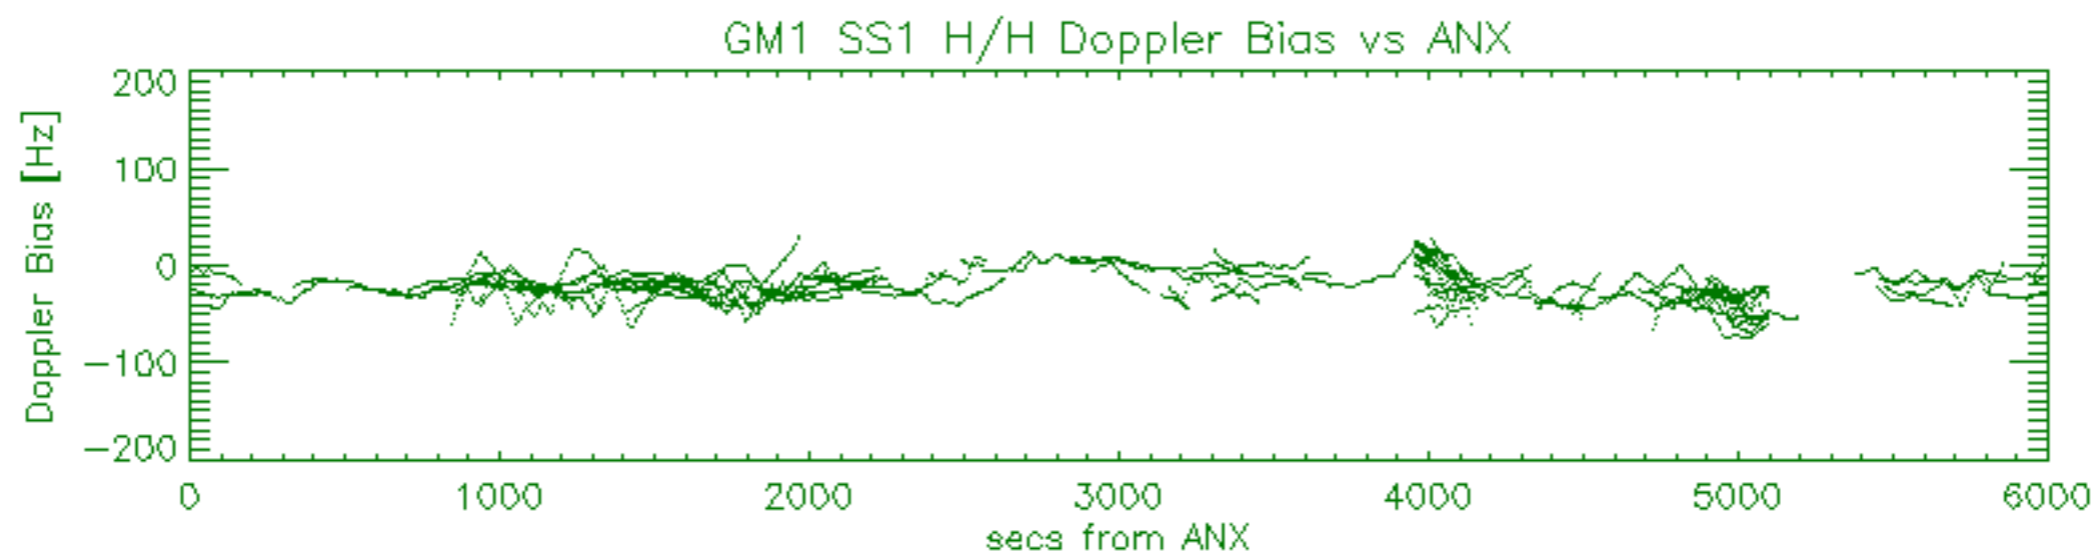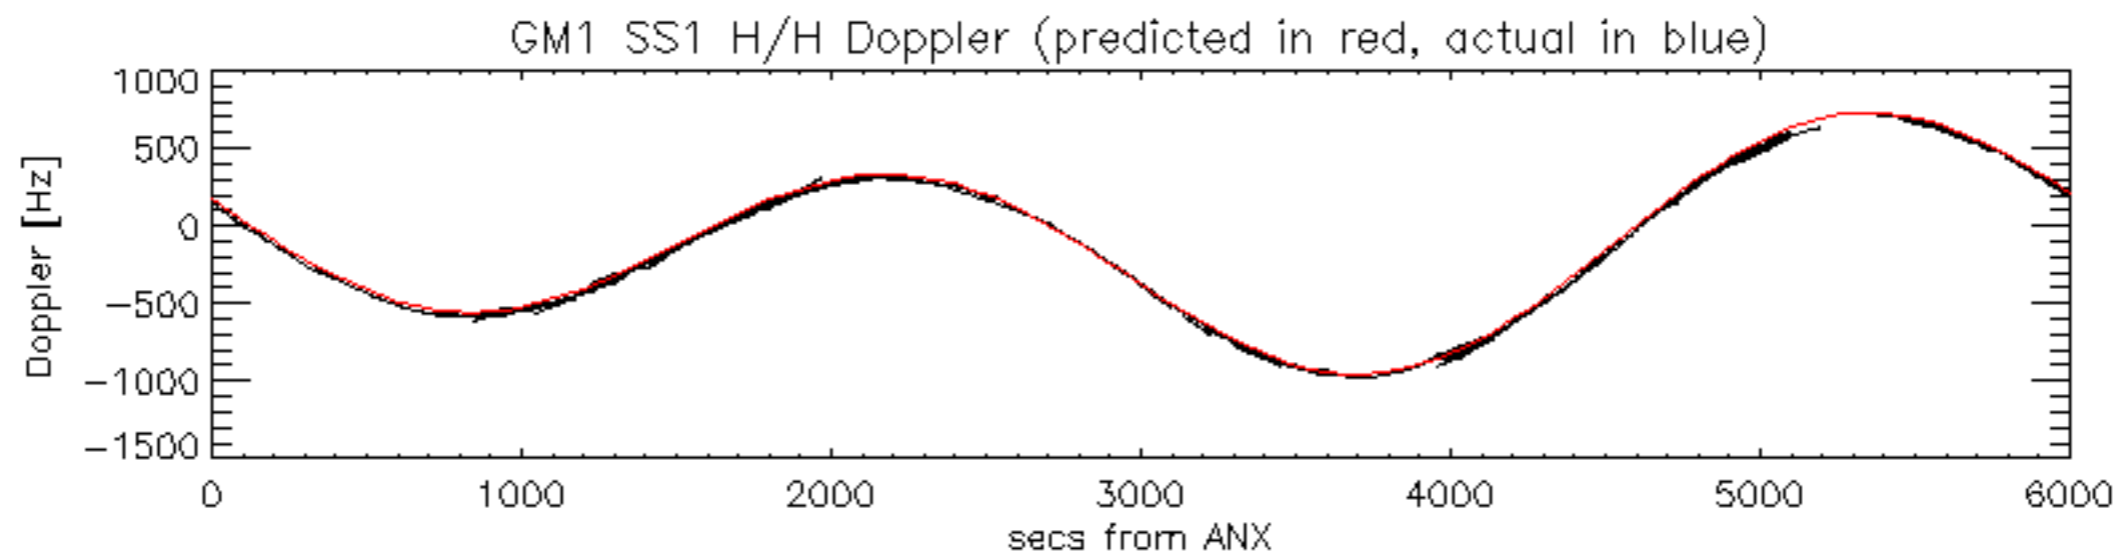



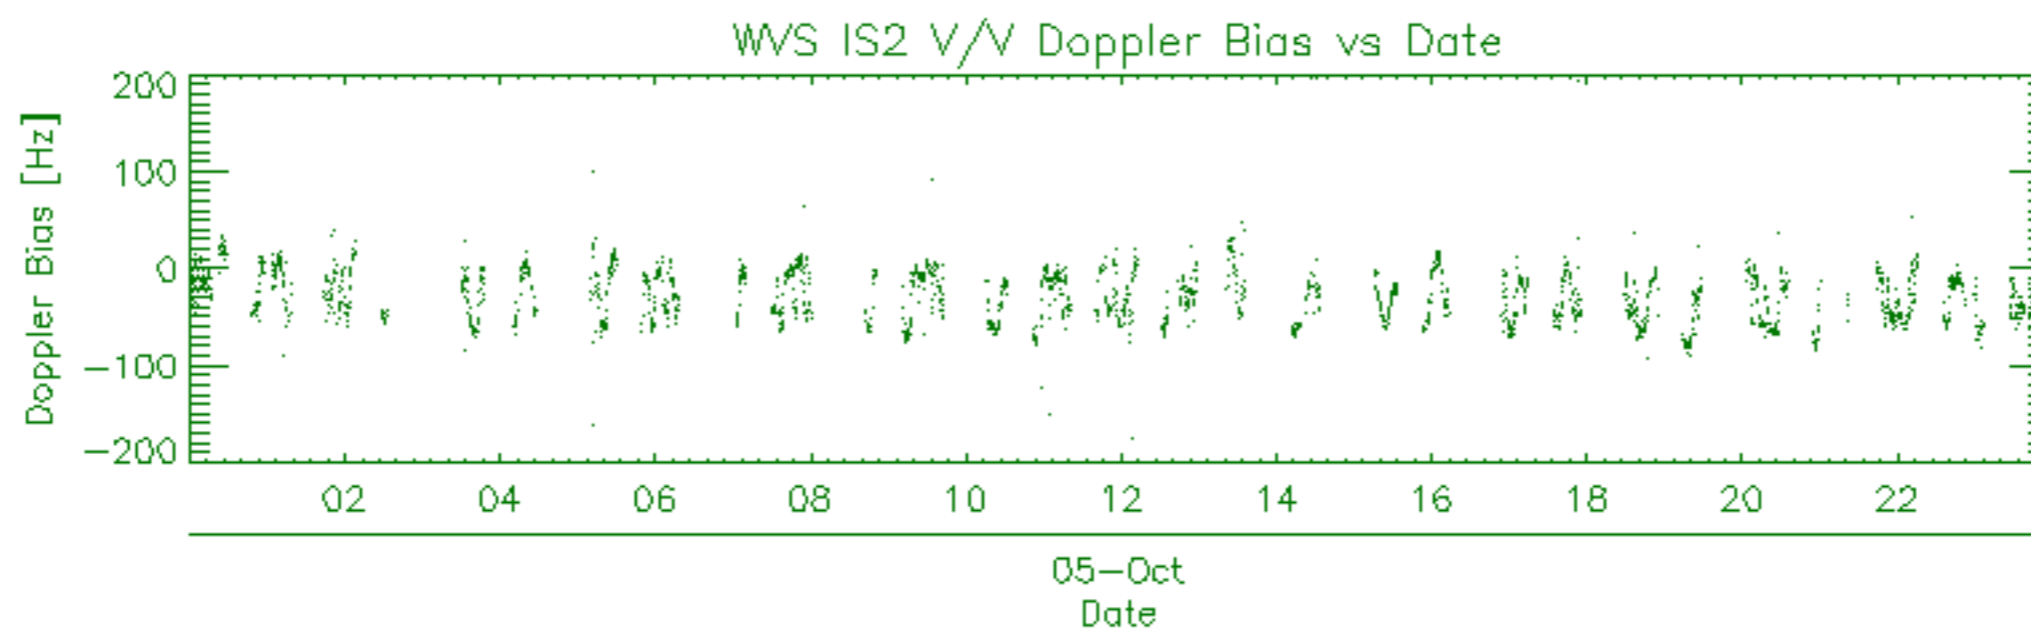
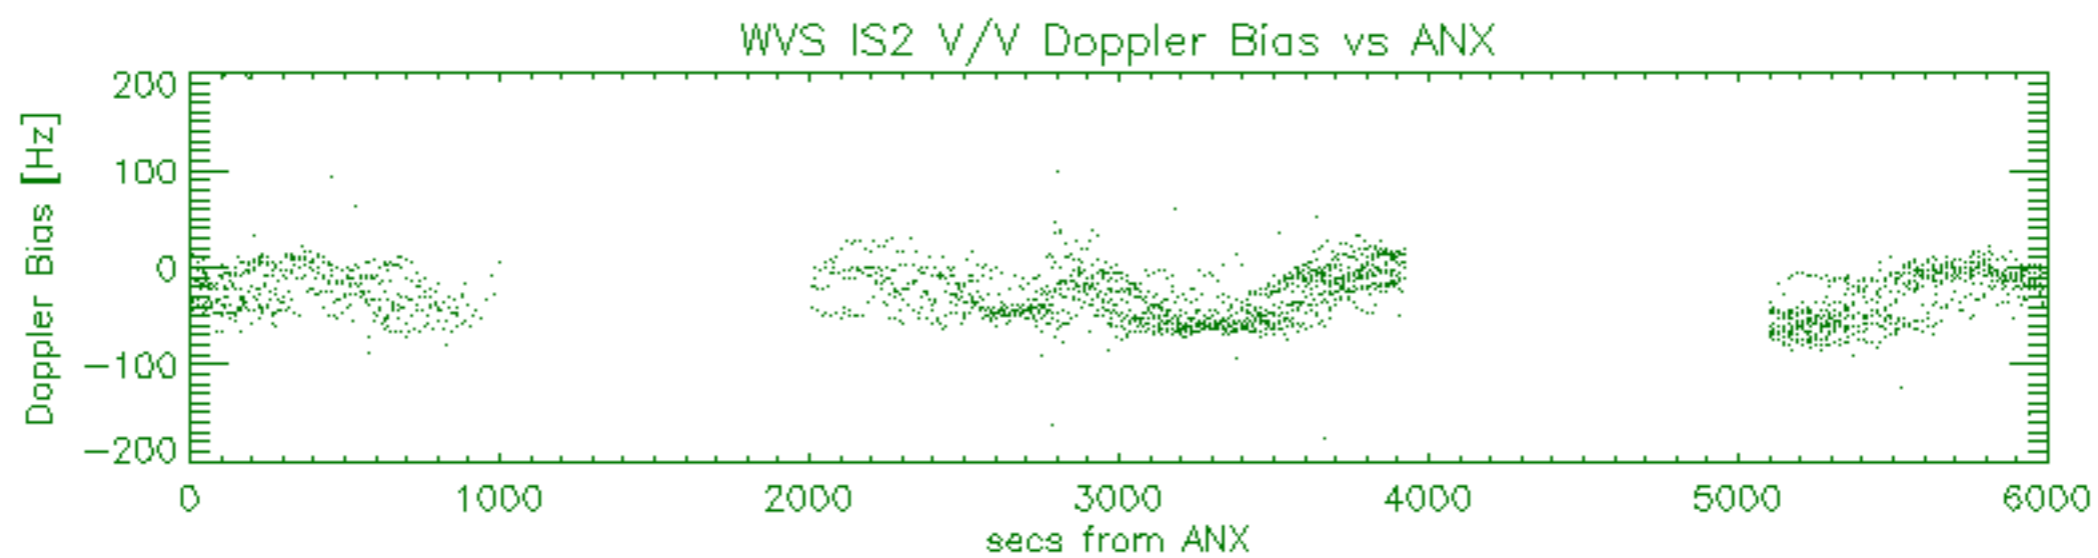
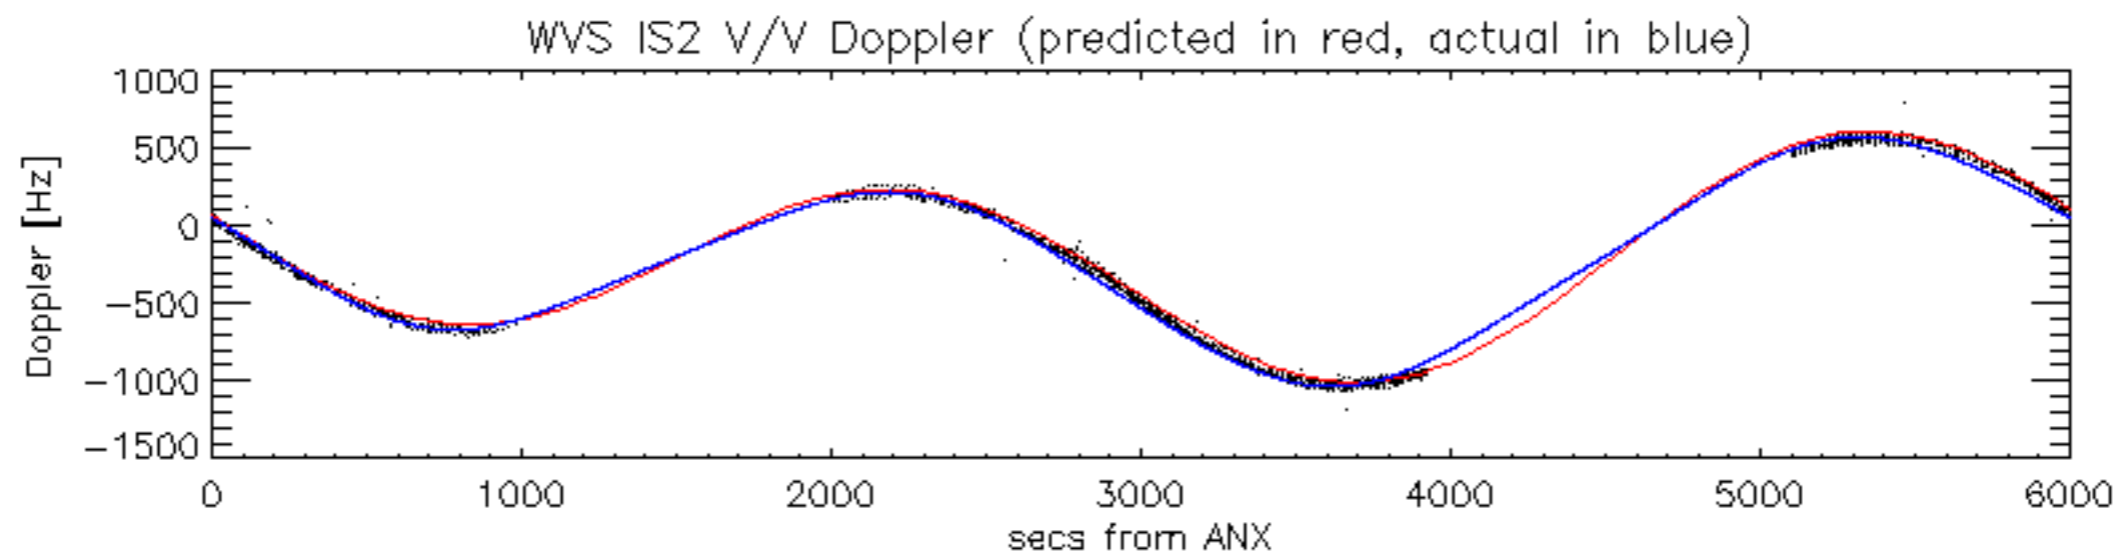


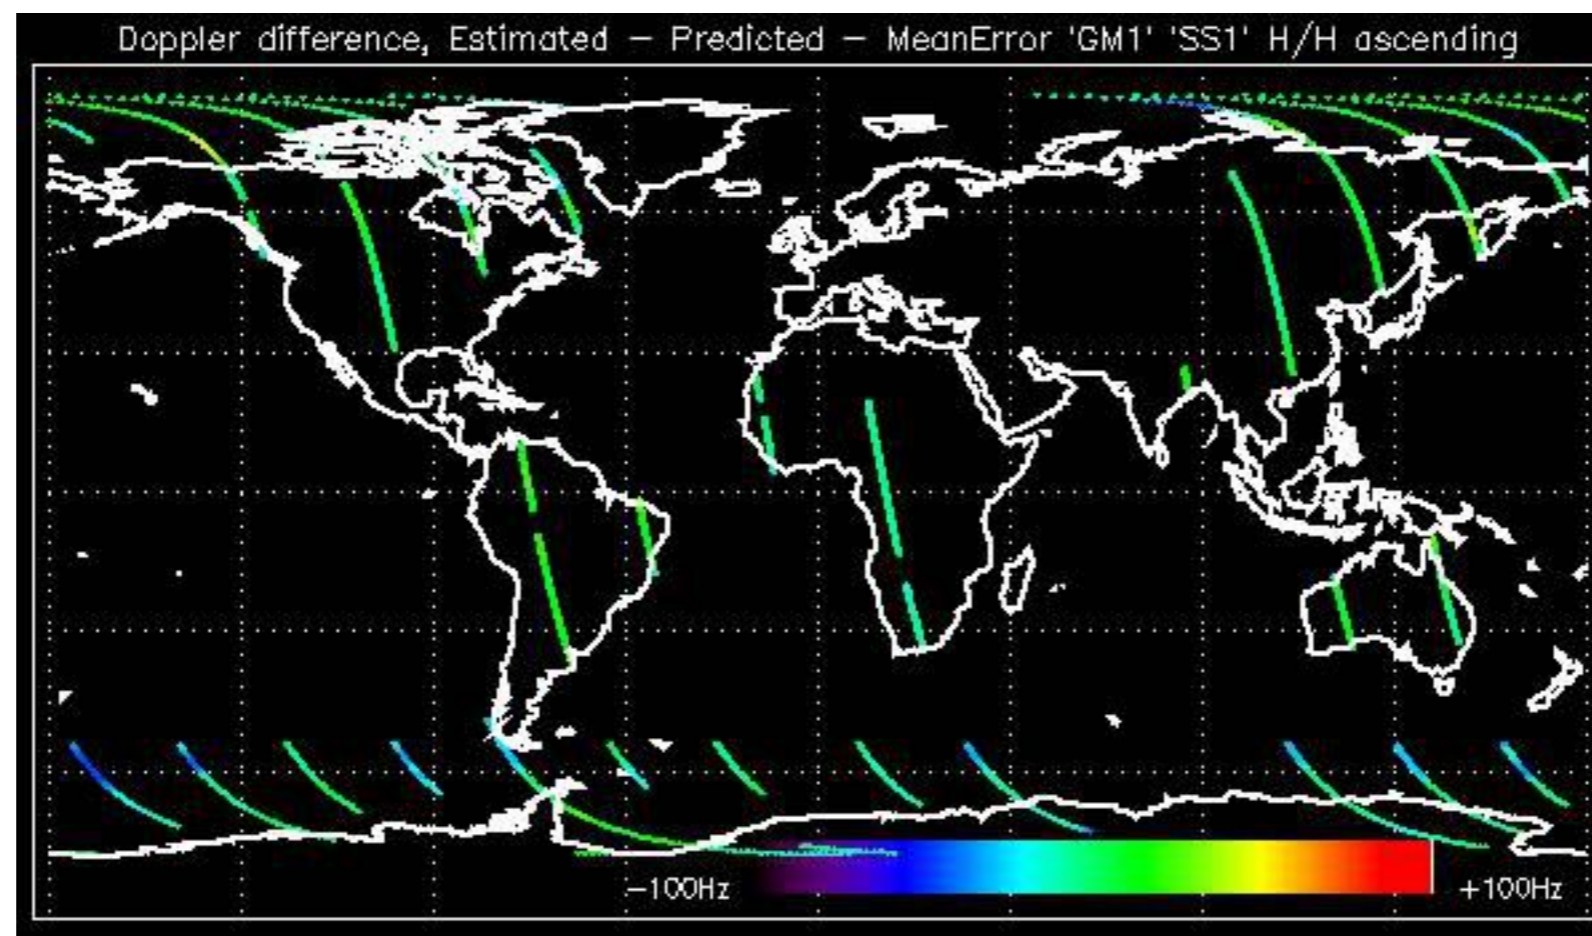


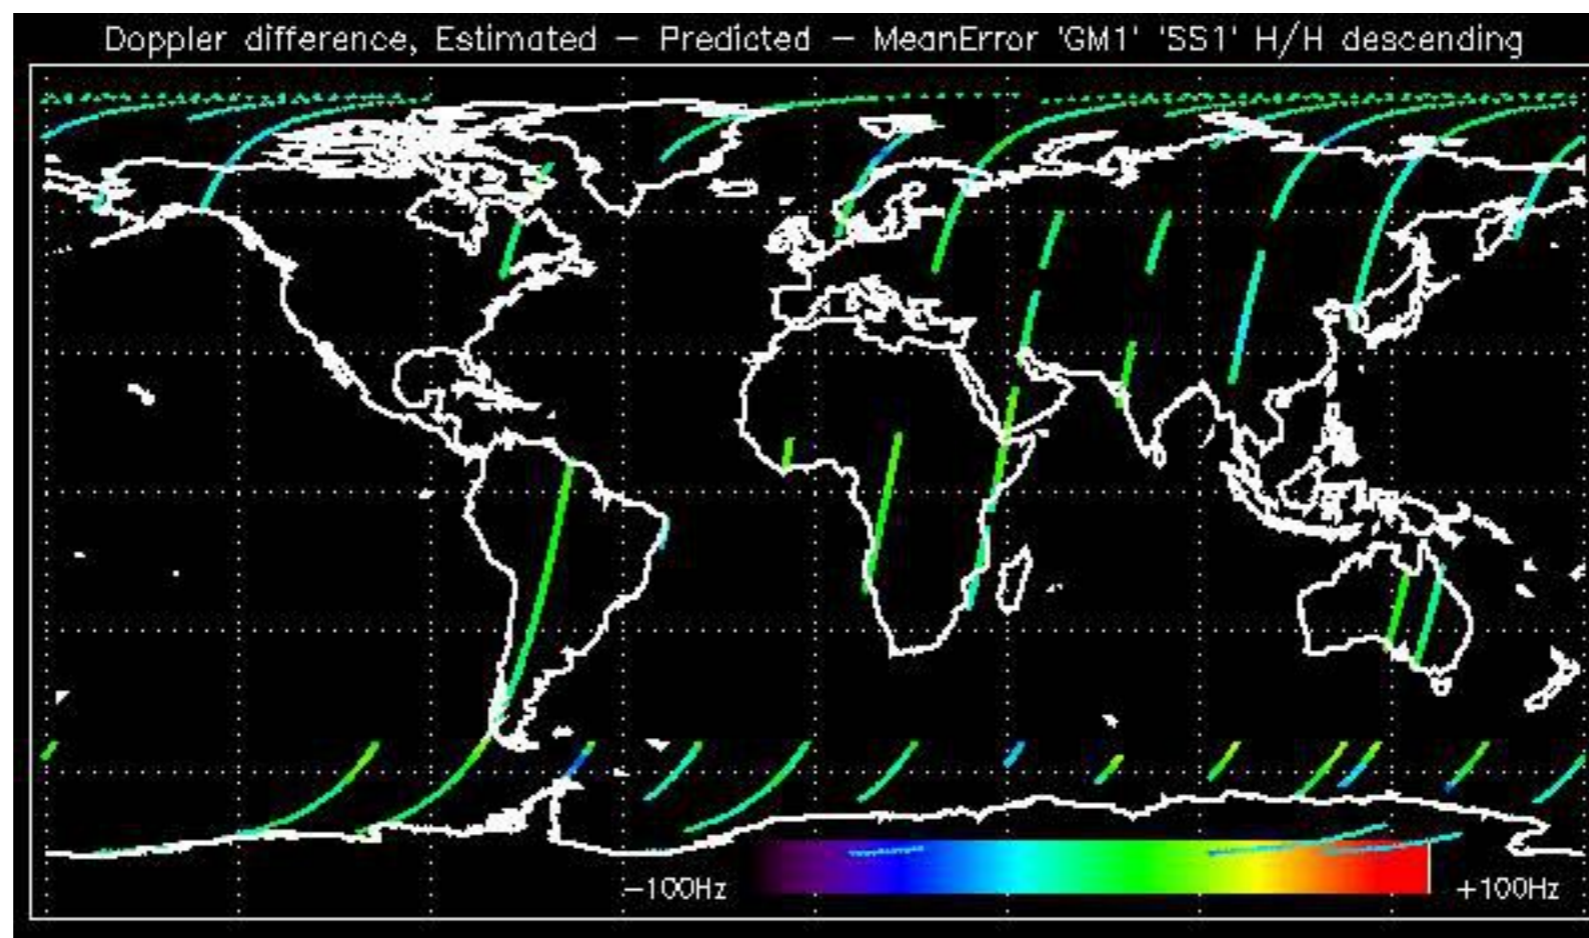


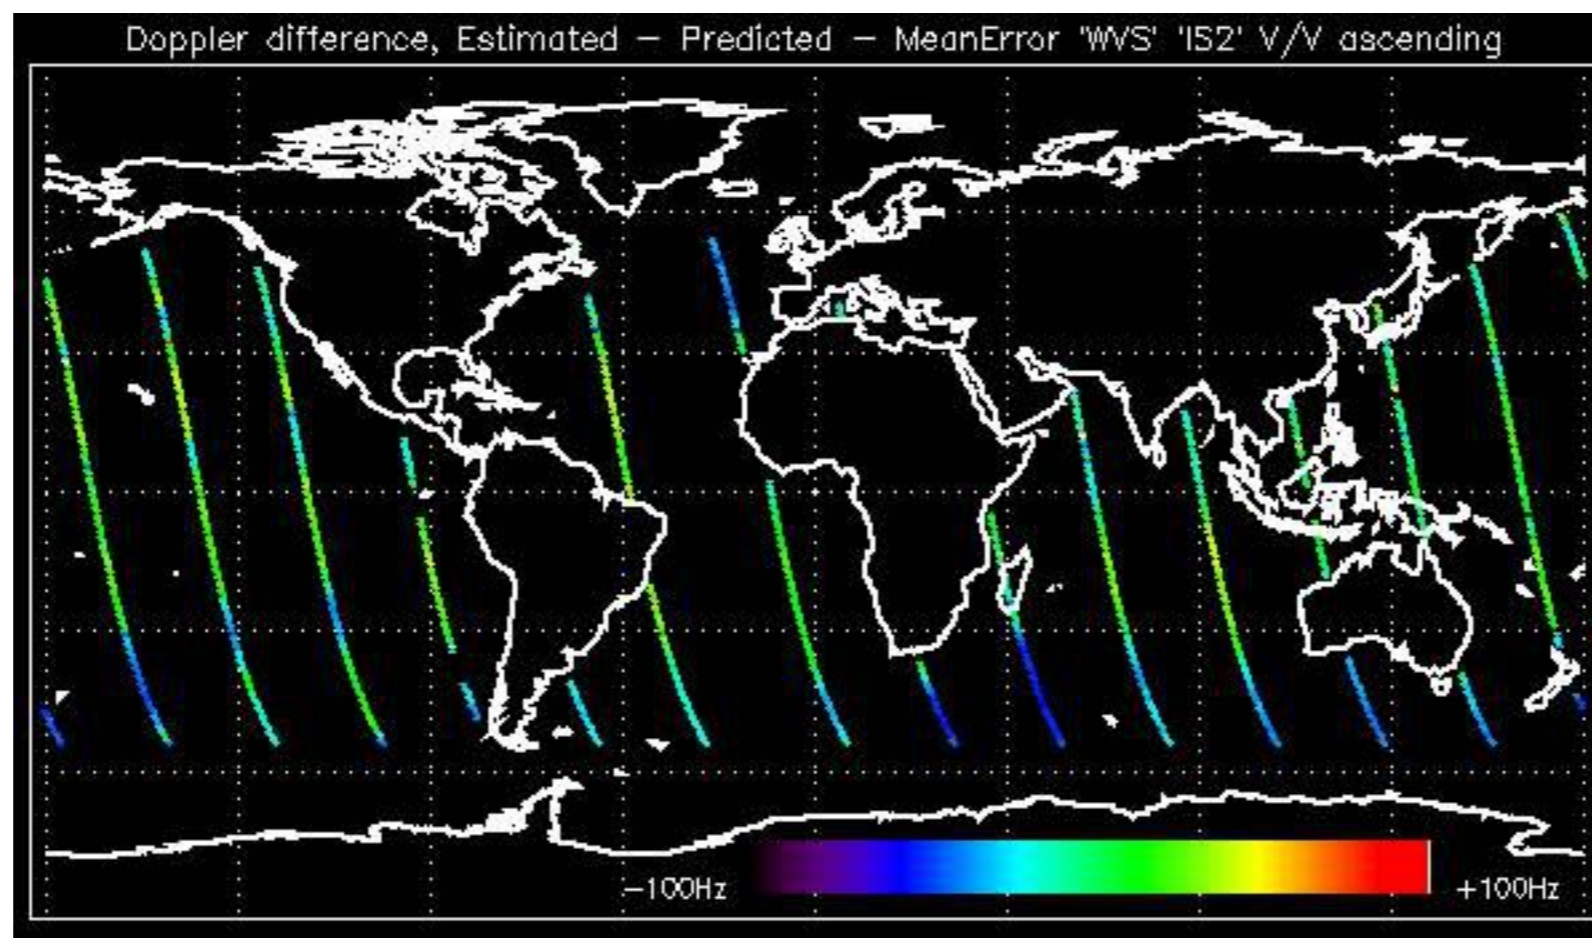


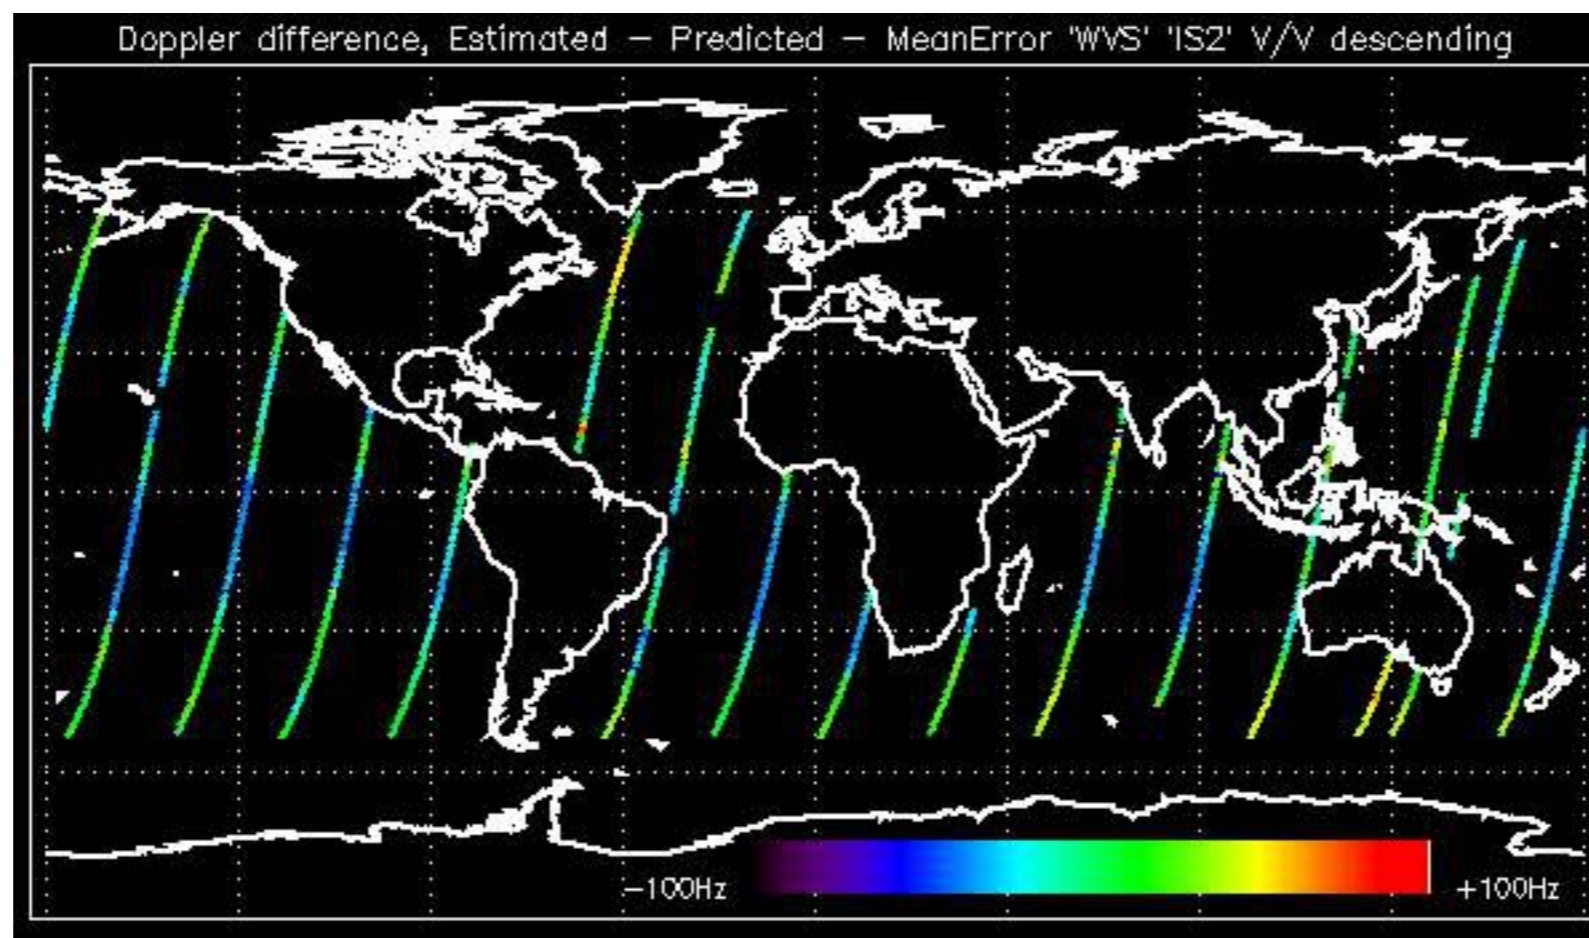

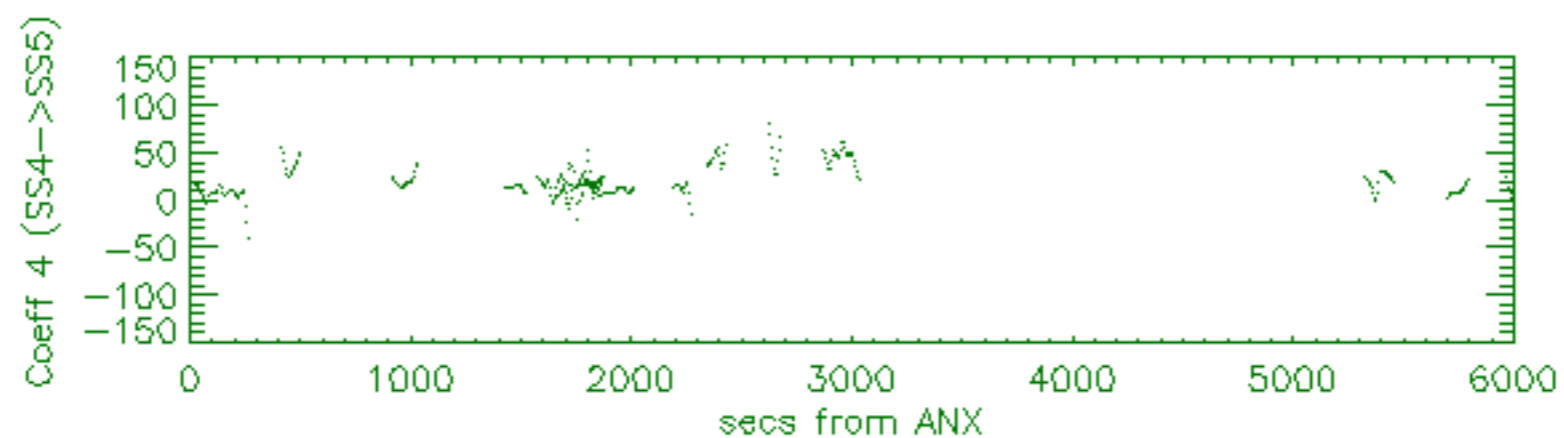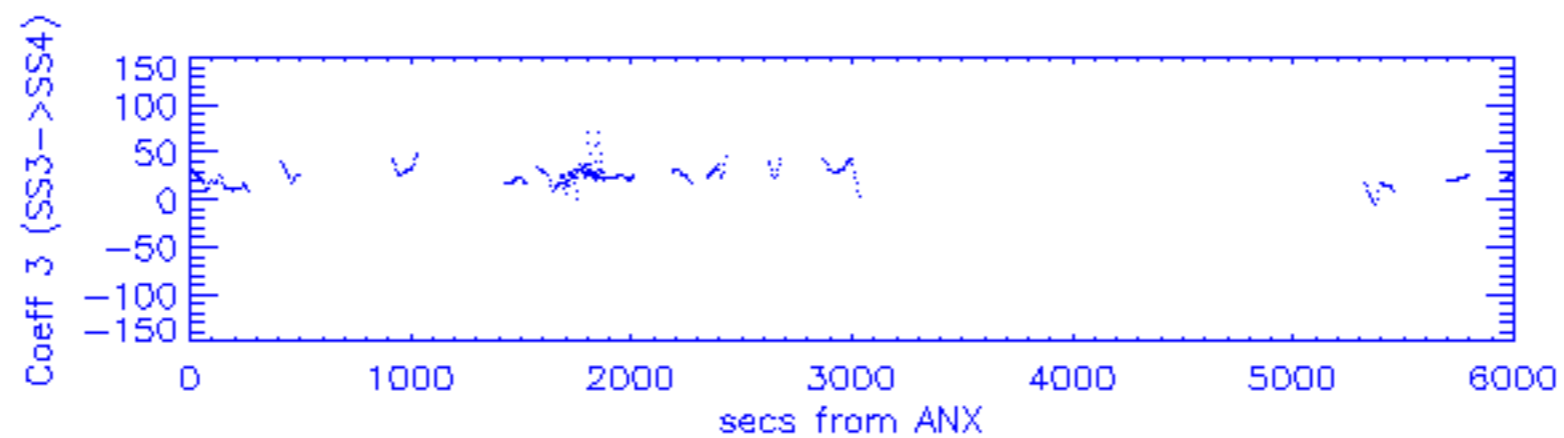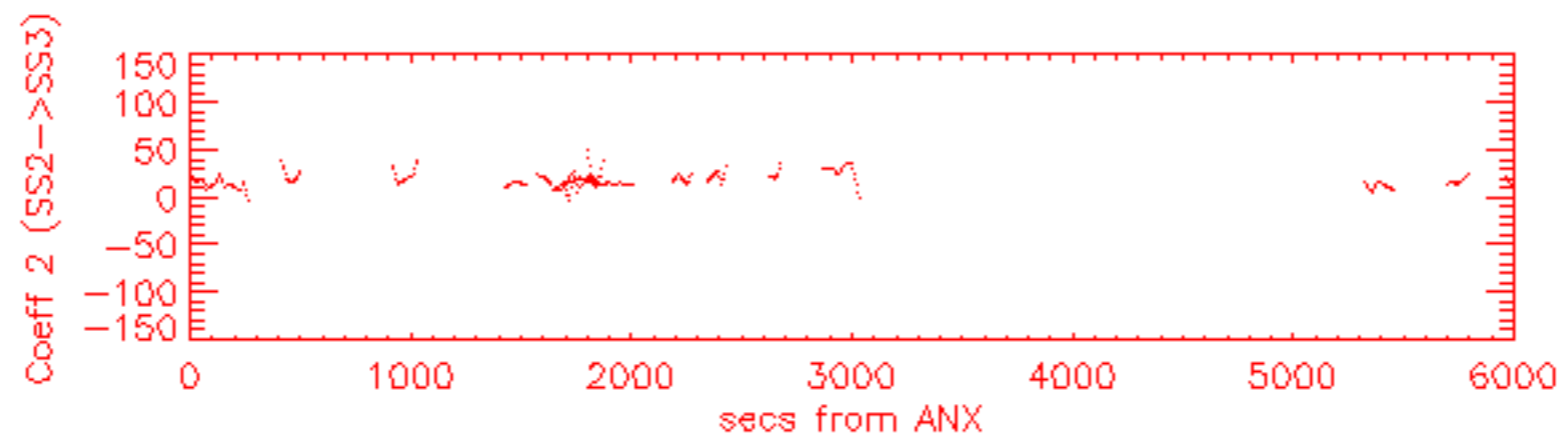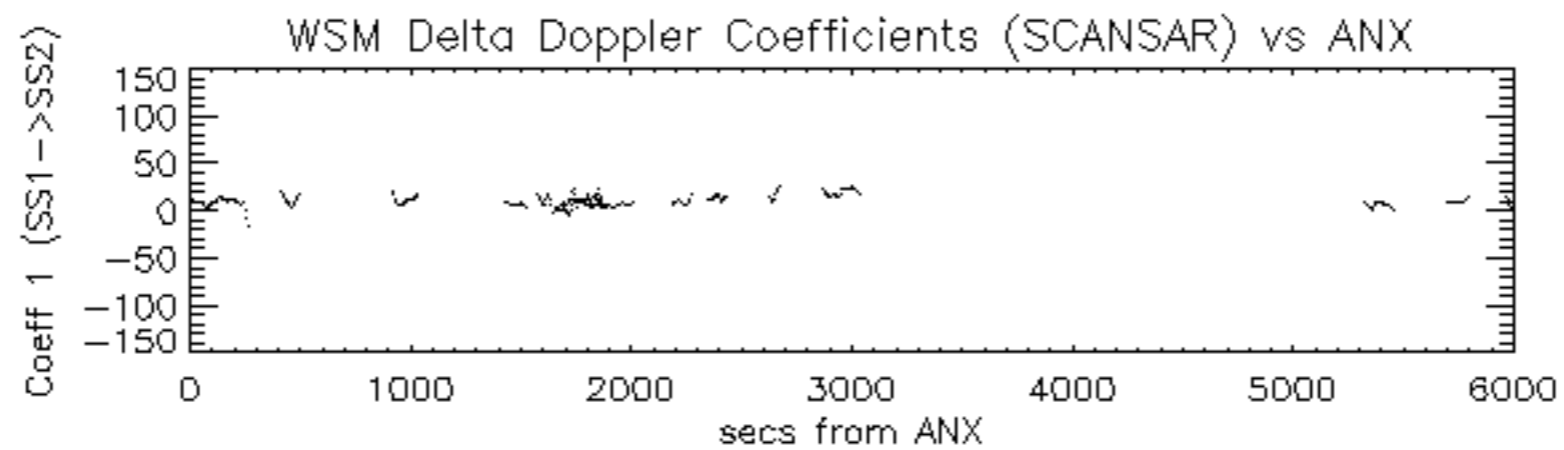


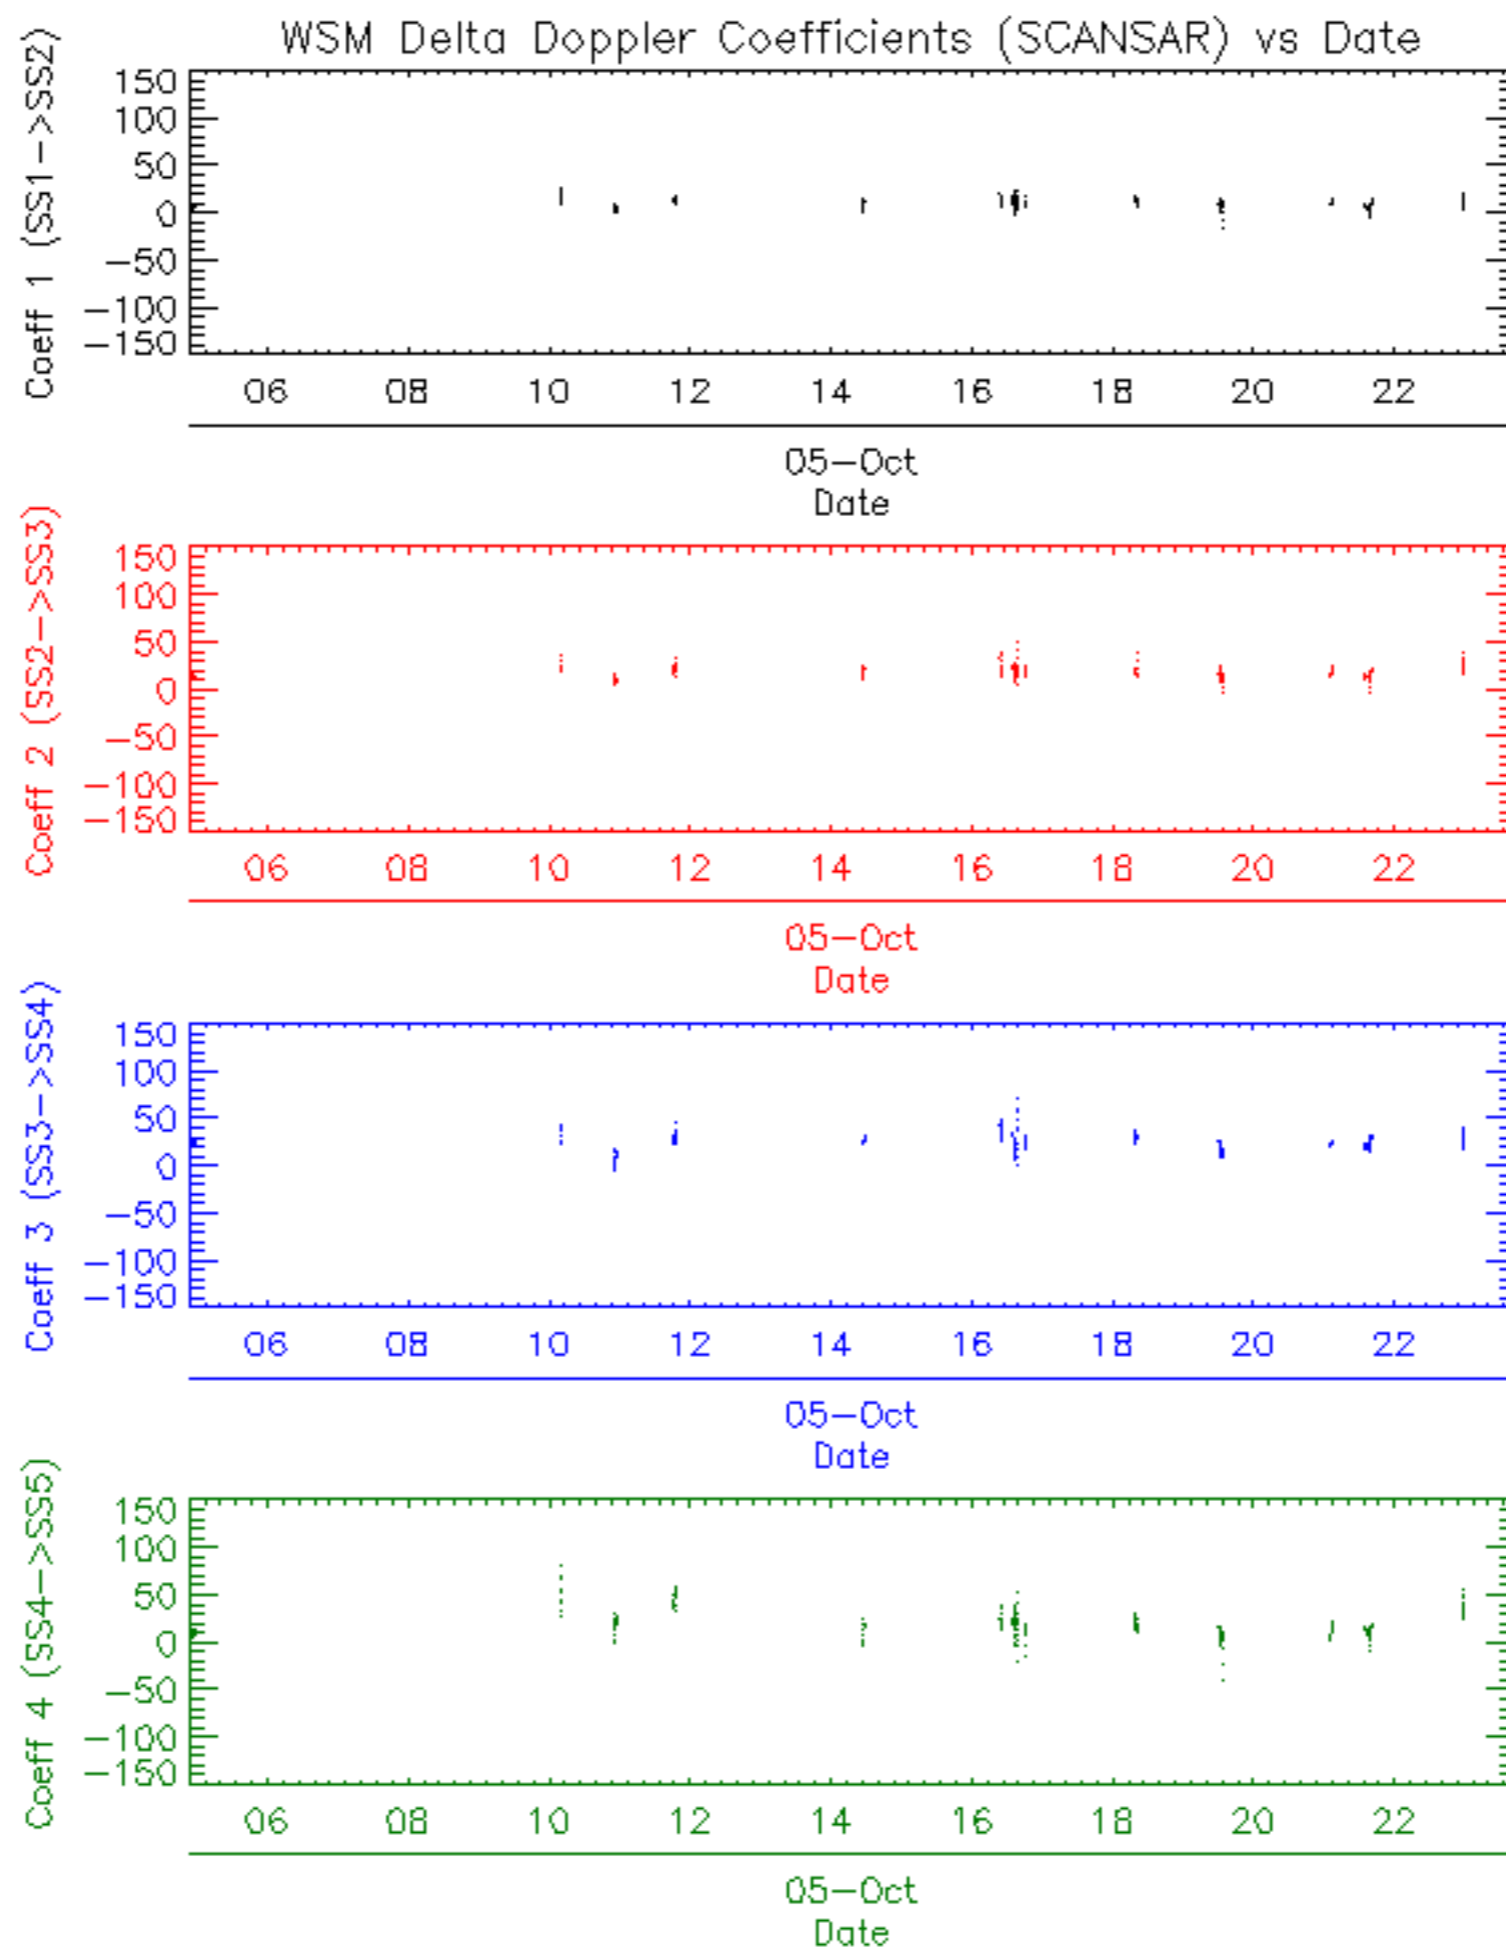

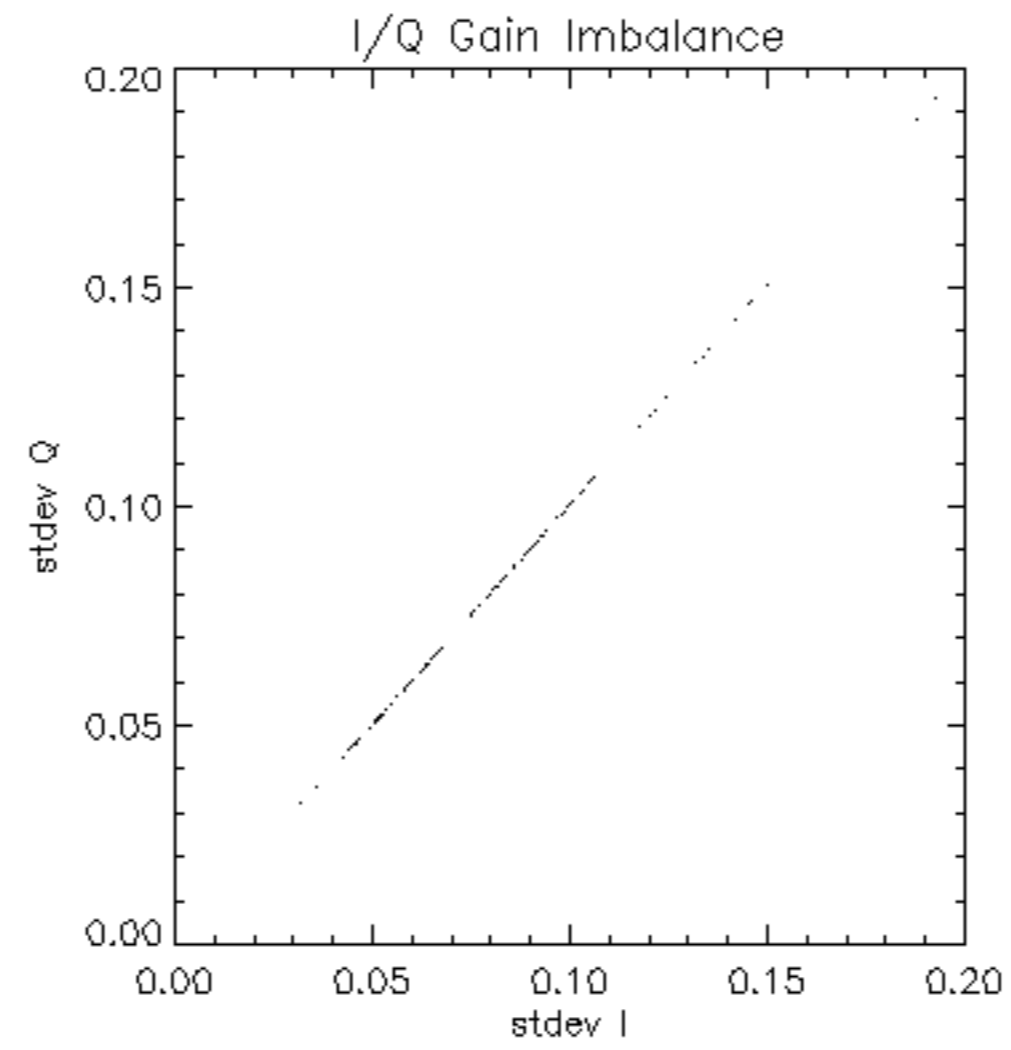


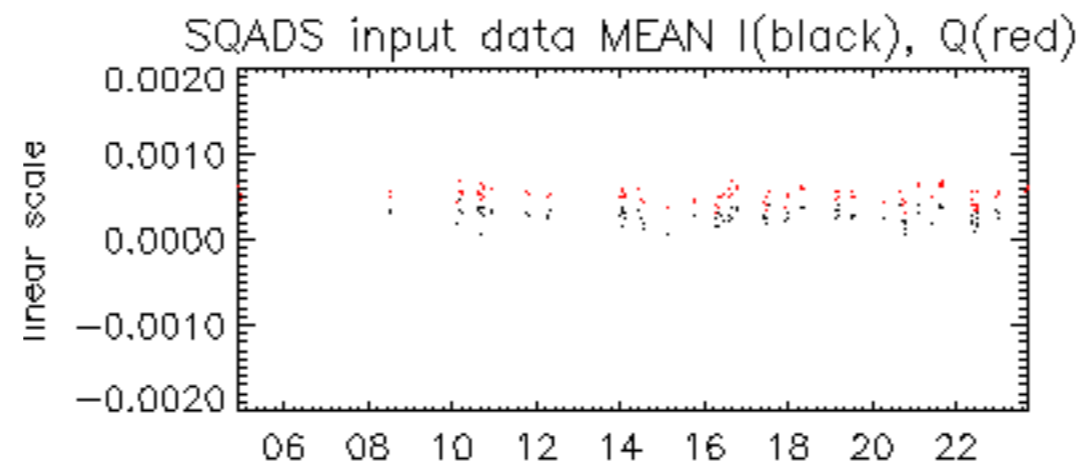

05-Oct

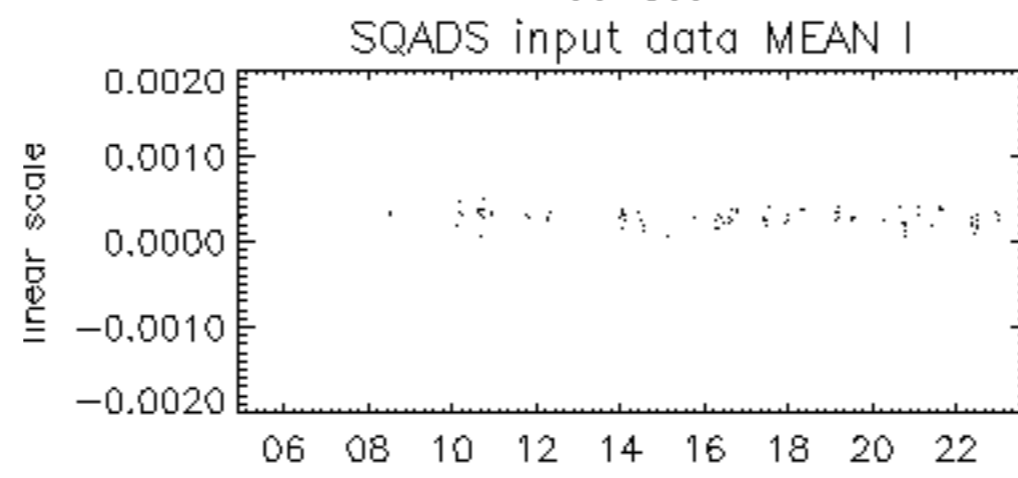

05-Oct

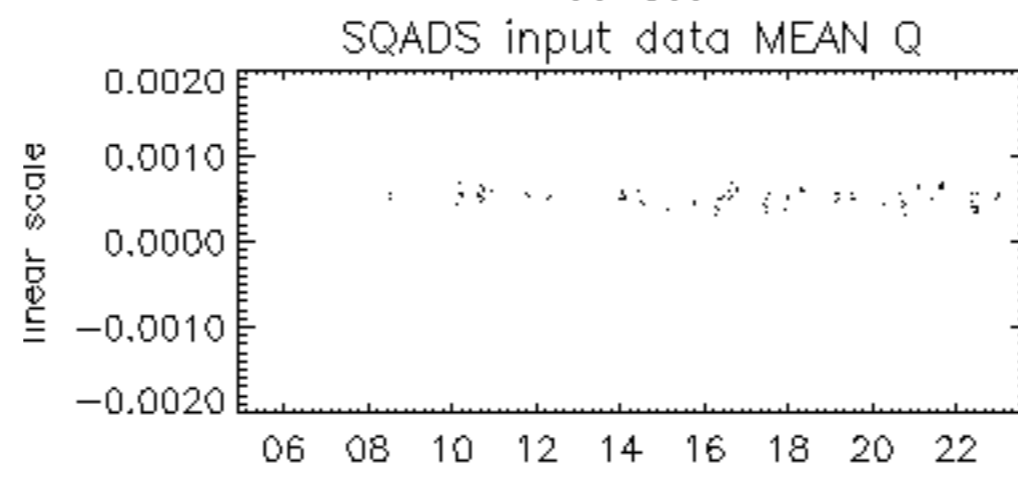

05-Oct

