



ASAR Daily Report



Analysis from 01-NOV-2008 00:00:00 to 01-NOV-2008 23:59:59. Page generated on 02-NOV-2008 07:56:49.
View log file: ASAR_Daily_Report_20081102_0730.log. For any anomalies please contact mtranfaglia@serco.it, gscarpino@serco.it, Emma.Griffiths@vega.co.uk.

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

SUMMARY

1. DATA SUMMARY
 - 1.1 Summary tables
 - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
 - 2.1 IECF operational ADFs list
 - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
 - 3.1 V/V polarisation
 - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
 - 4.1 Analysis for WVS IS2 V/V
 - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
 - 4.1.2 All Rows Analysis for WVS IS2 V/V
 - 4.2 Analysis for GM1 SS3 H/H
 - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
 - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
 - 5.1 Analysis for WVS IS2 V/V
 - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
 - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
 - 5.2 Analysis for GM1 SS1 H/H
 - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
 - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
 - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
 - 6.1 Analysis for WSM SS1 H/H
 - 6.1.1 ScaleFactor
 - 6.2 Analysis for WSM SS1 V/V
 - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
 - 7.1 Analysis for WVS
 - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
 - 8.1 Number of Missing Lines
 - 8.2 Number of Gaps

1 - DATA SUMMARY

1.1 - Summary tables

[[BACK TO MENU](#)]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	2	PDE	WS	H/H	25	PDE	IS2	H/H	1	PDE	IS1	H/H	3	PDE	WS	H/H	35	PDE	2008-11-01 03:02:34	H	320
PDE	IS2	V/V	19	PDK	WS	H/H	50	PDE	IS4	H/V	1	PDE	IS1	V/V	1	PDE	WS	V/V	10	PDE	2008-11-01 22:29:16	H	320
PDK	IS2	V/V	27					PDK	IS2	H/H	1	PDE	IS2	***	1								
												PDE	IS2	H/H	11								
												PDE	IS2	V/V	7								
												PDE	IS3	H/H	1								
												PDE	IS6	V/V	2								
												PDK	IS2	H/H	1								
												PDK	IS2	V/V	3								

1.2 - Lists of products used

[[BACK TO MENU](#)]

[[TXT](#)] [[XLS](#)] [List_WVS_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_GM1_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_APM_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_IMM_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_WSM_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_MS_products_used](#)

2 - AUXILIARY FILES ANALYSIS

2.1 - IECF operational ADFs list

[[BACK TO MENU](#)]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20080710_132557_20070204_165113_20081231_000000
ASA_INS_AXVIEC20071218_083603_20070307_060000_20081231_000000
ASA_XCH_AXVIEC20051219_162547_20020301_000000_20081231_000000
ASA_XCA_AXVIEC20080710_133546_20070204_165113_20081231_000000

2.2 - Products with wrong ADFs

[[BACK TO MENU](#)]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0

[[TXT](#)] [[XLS](#)] [Check_ADFs_WVS](#)
 [[TXT](#)] [[XLS](#)] [Check_ADFs_GM1](#)
 [[TXT](#)] [[XLS](#)] [Check_ADFs_APM](#)
 [[TXT](#)] [[XLS](#)] [Check_ADFs_IMM](#)
 [[TXT](#)] [[XLS](#)] [Check_ADFs_WSM](#)

3 - MODULE STEPPING PRODUCTS ANALYSIS









3.2 - H/H polarisation

[[BACK TO MENU](#)]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
After antenna maintenance (2005-09-22/23)	Previous product in the same polarisation

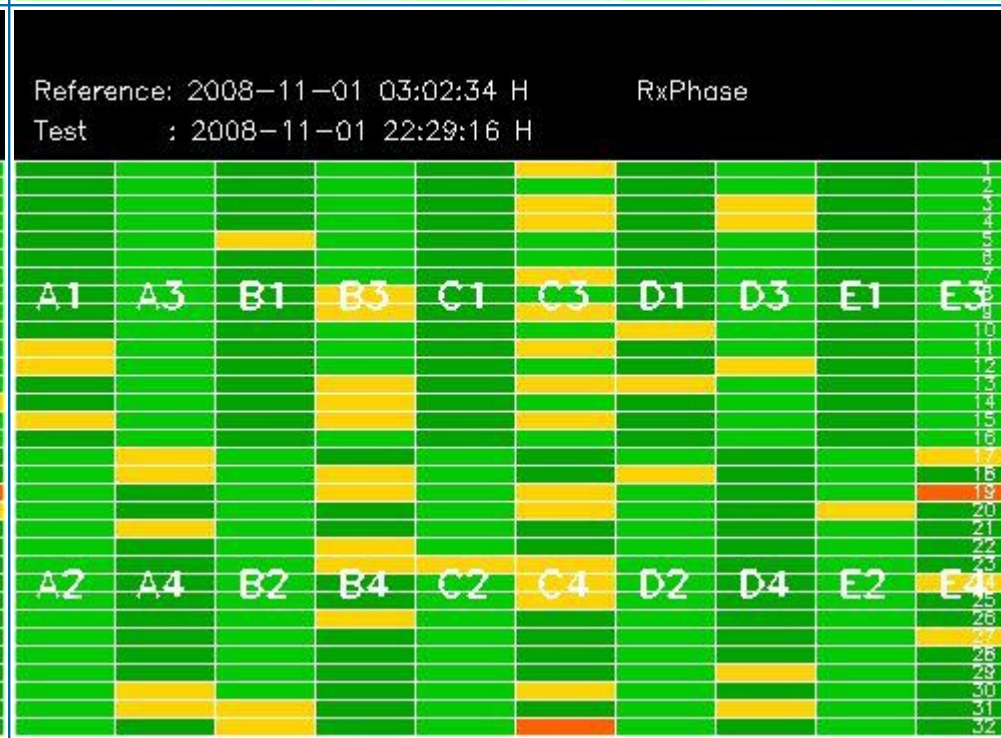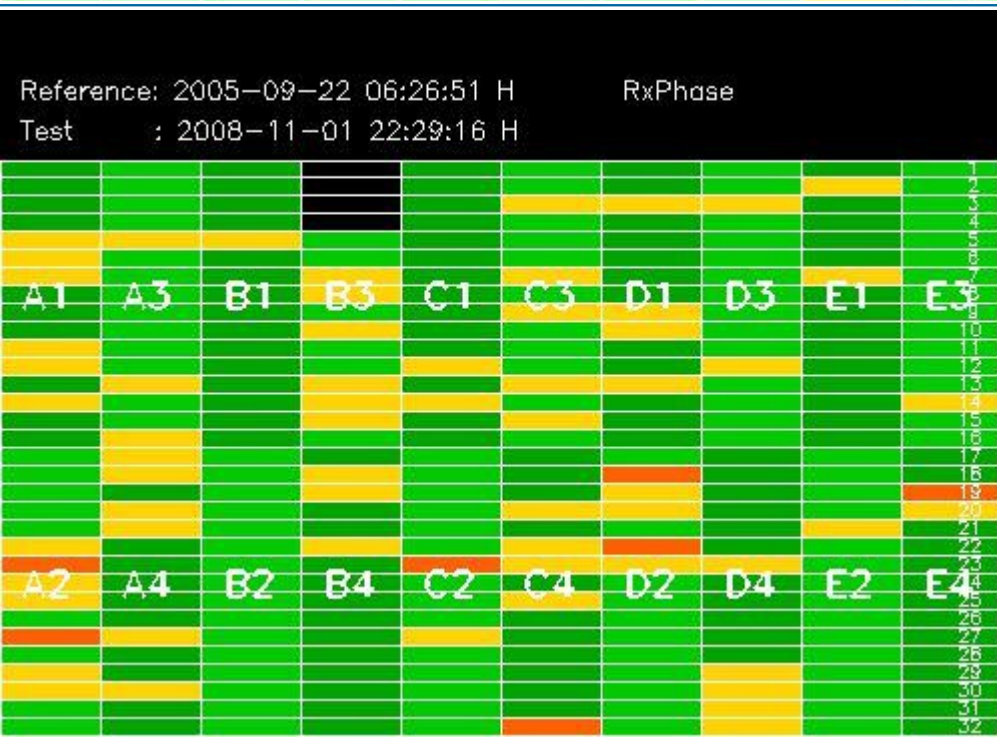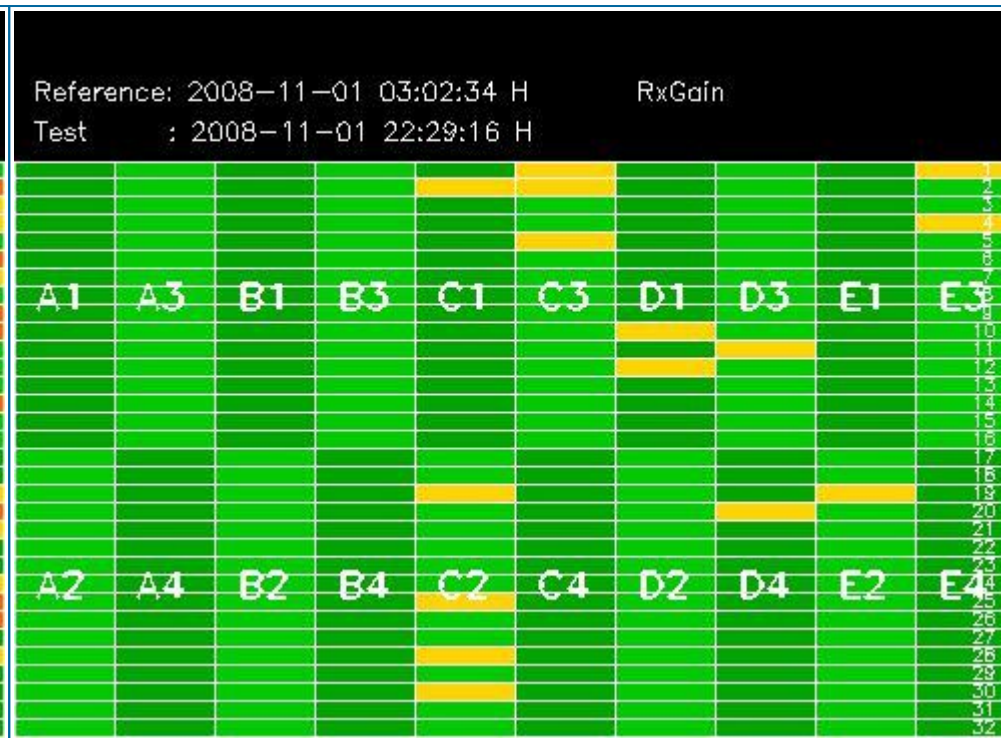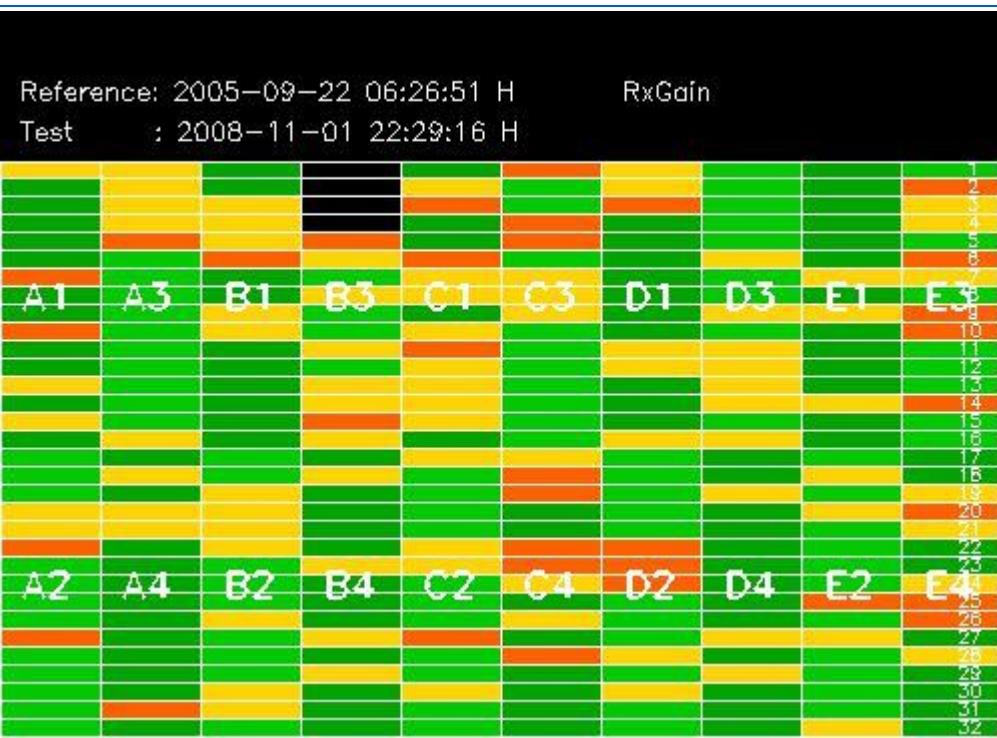



4 - CALIBRATION PULSES ANALYSIS

4.1 - Analysis for WVS IS2 V/V


4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for WVS IS2 V/V

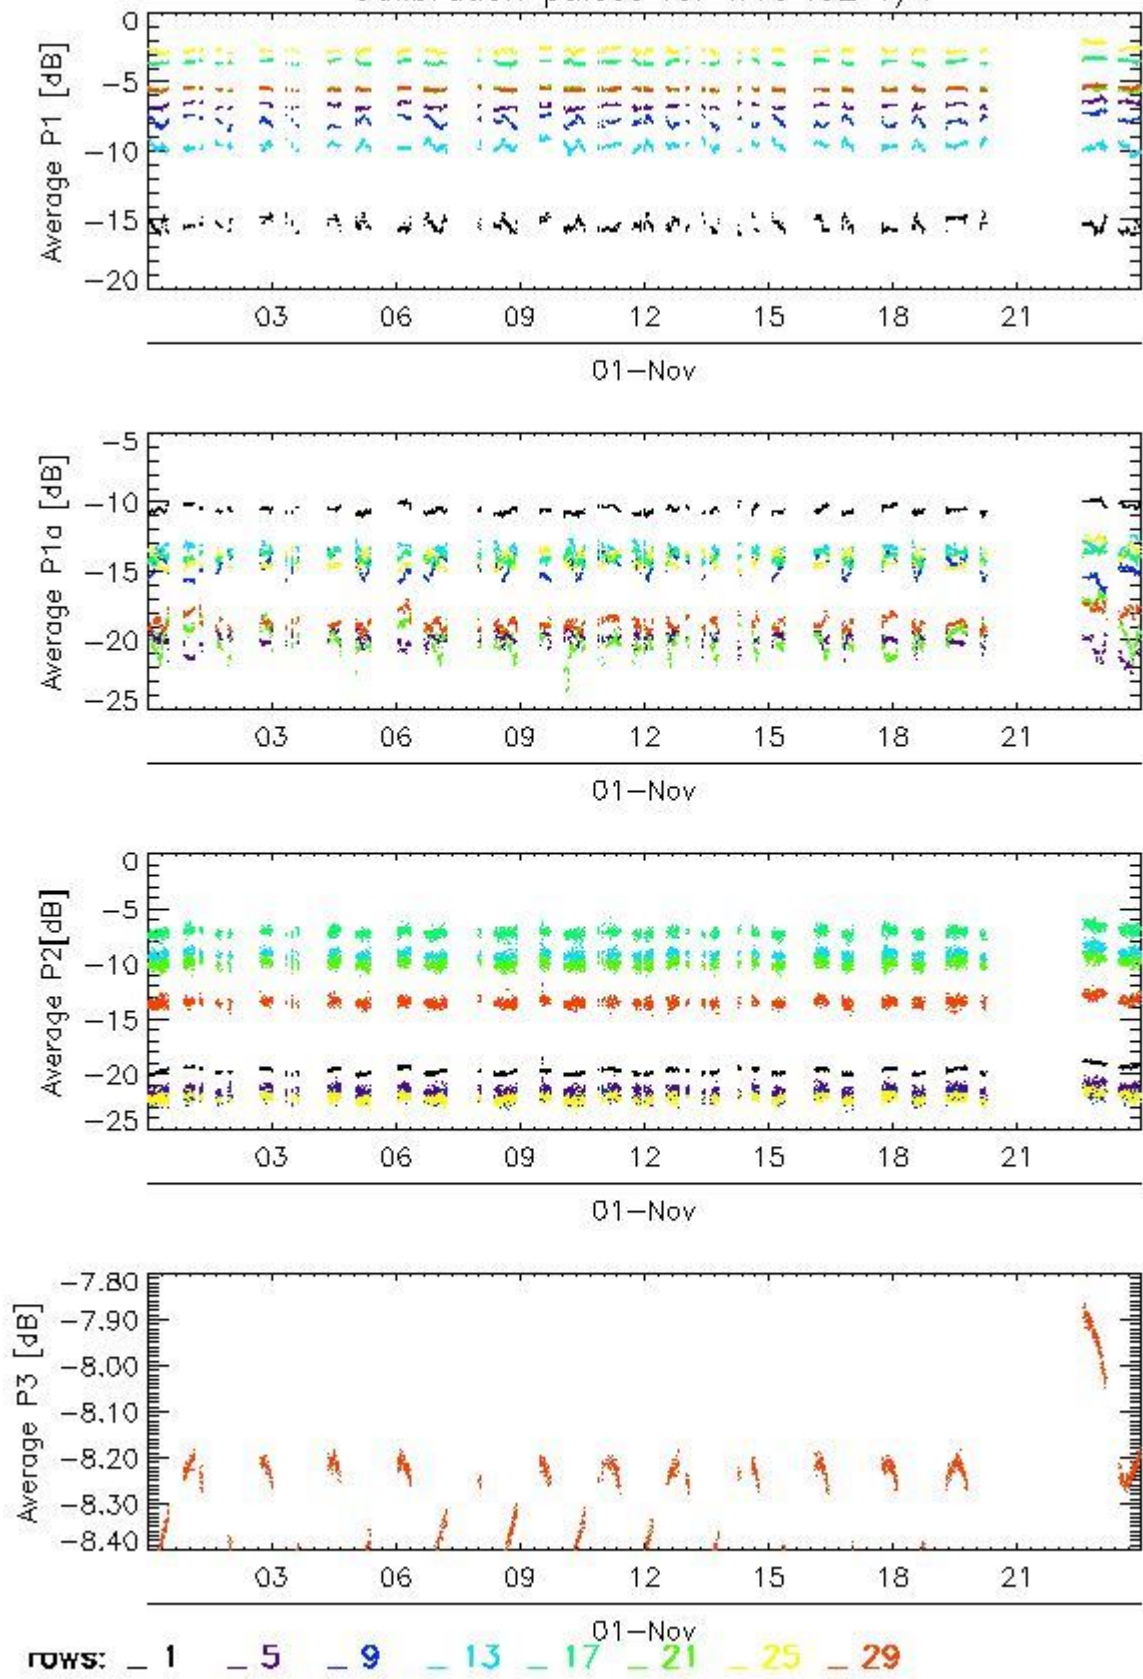


Transmit power (P1 - P1a) for WVS IS2 V/V

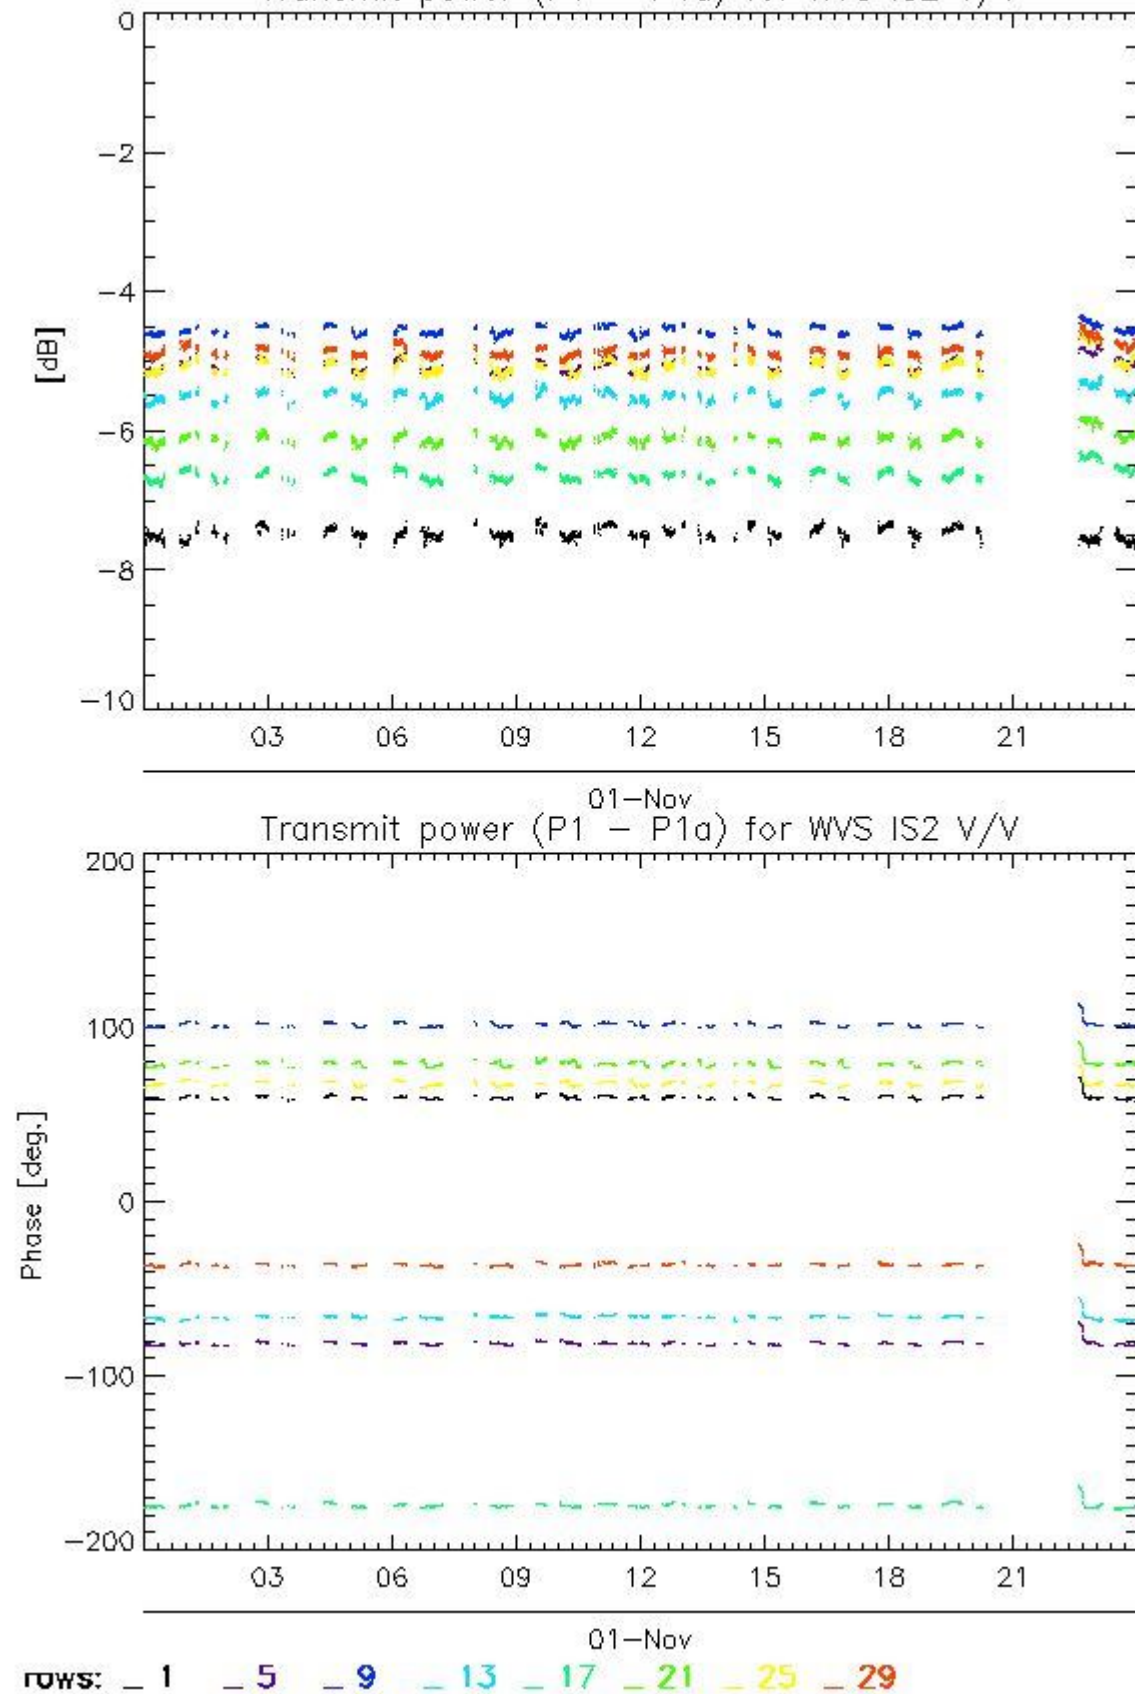

4.1.2 - All Rows Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



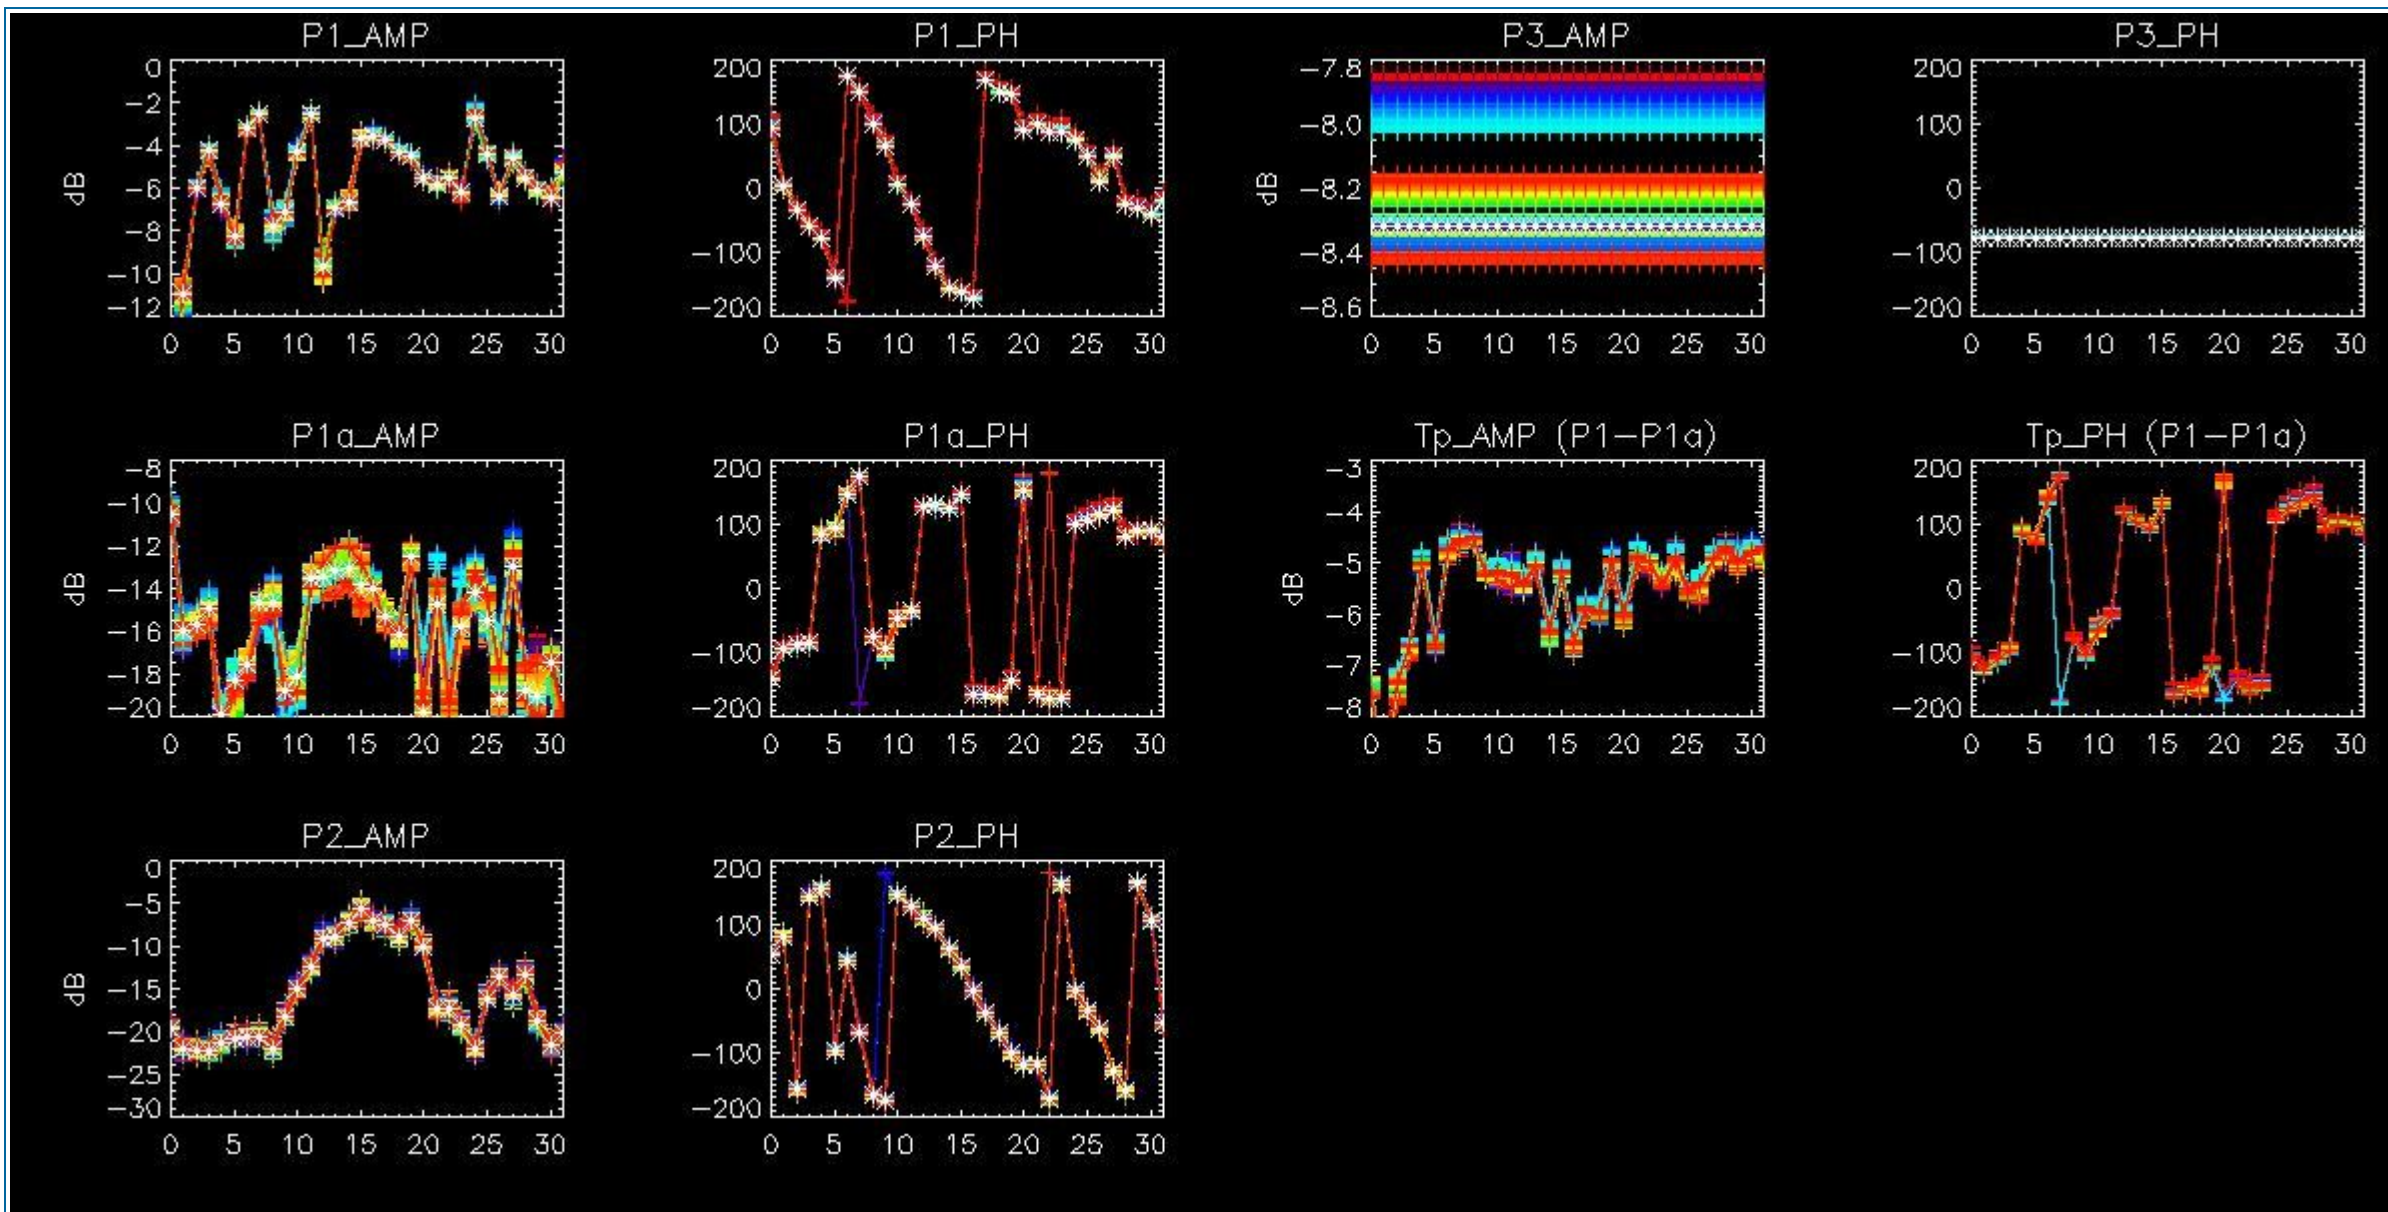

4.2 - Analysis for GM1 SS3 H/H


4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for GM1 SS3 H/H

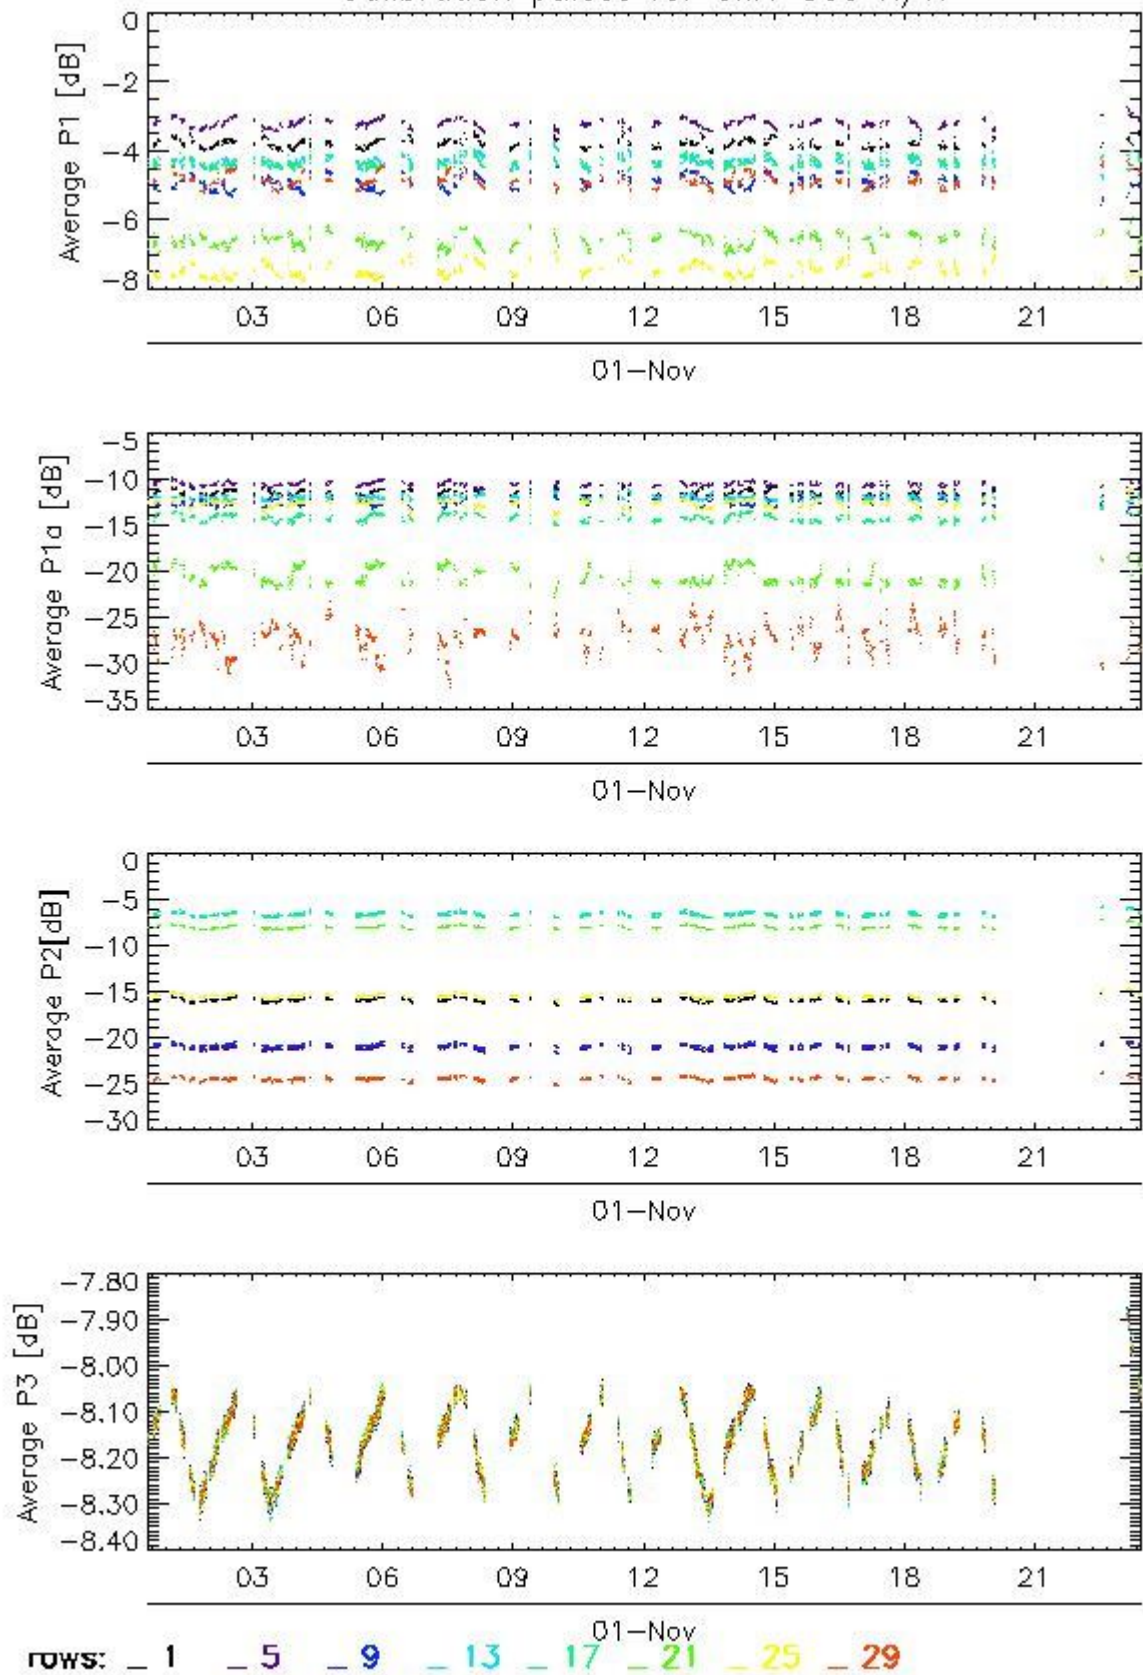


Transmit power (P1 - P1a) for GM1 SS3 H/H

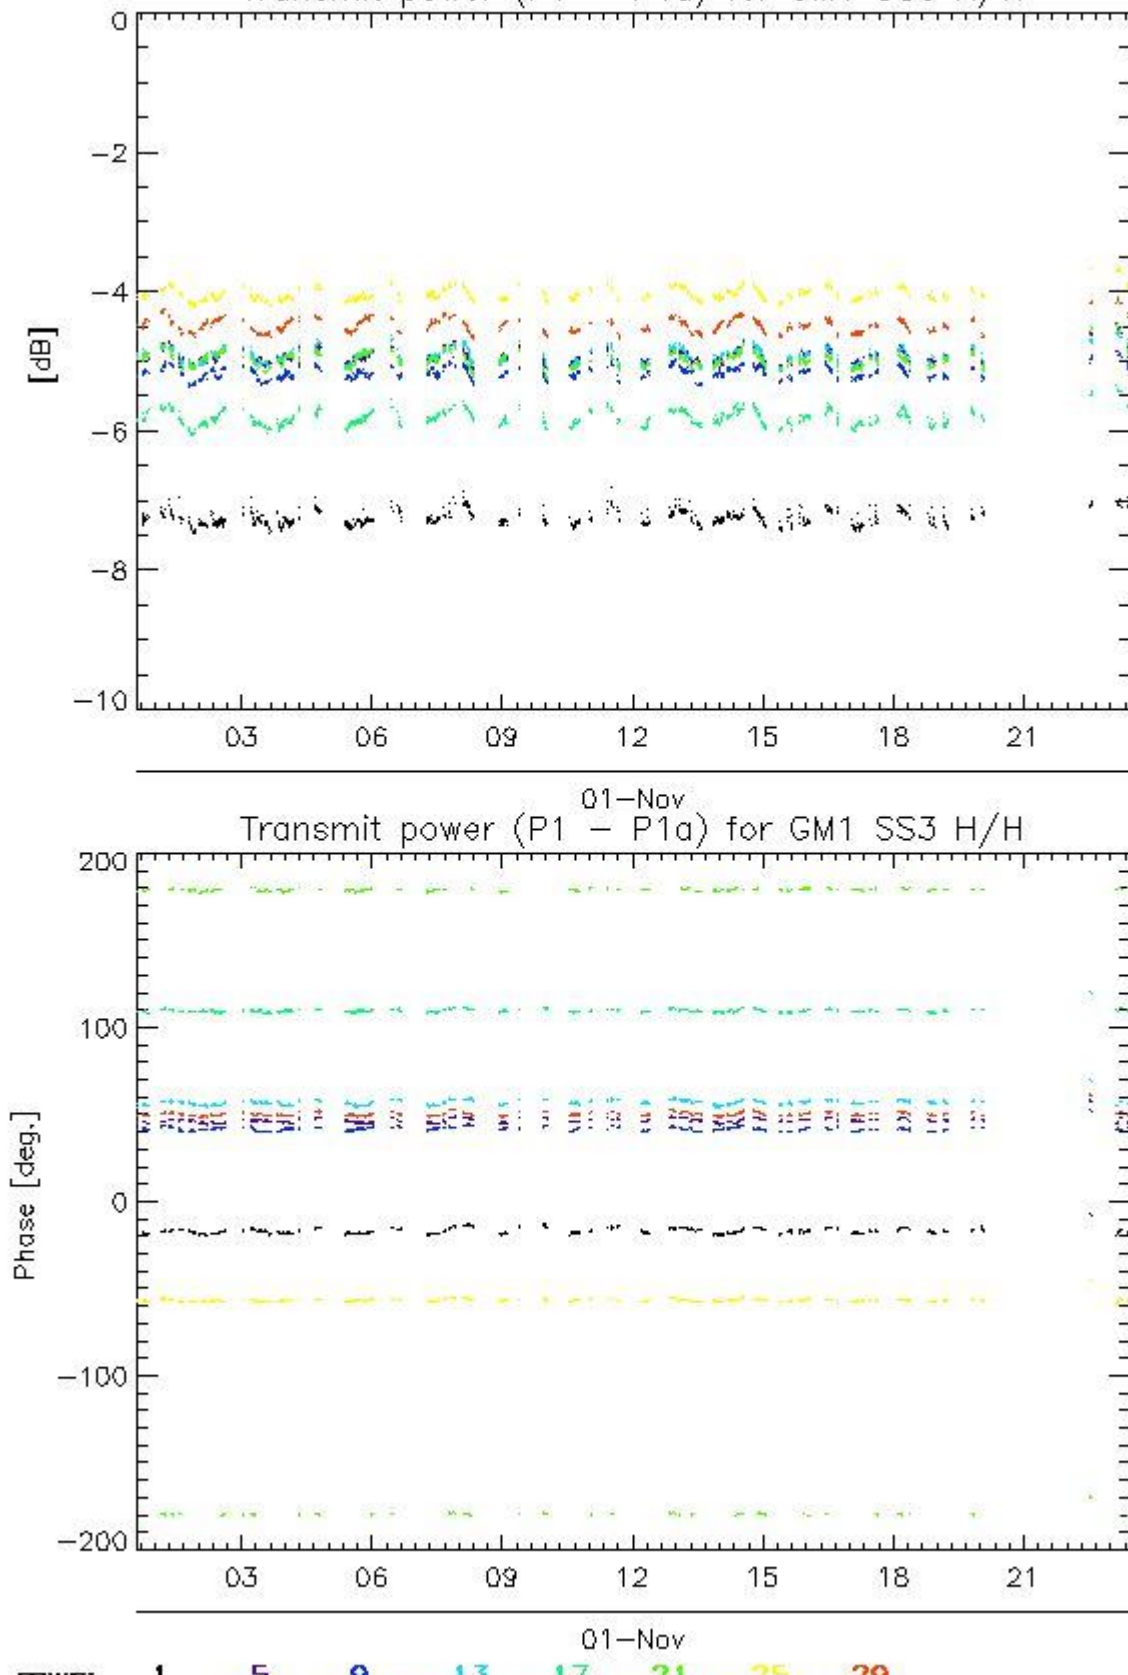

4.2.2 - All Rows Analysis for GM1 SS3 H/H

[BACK TO MENU]



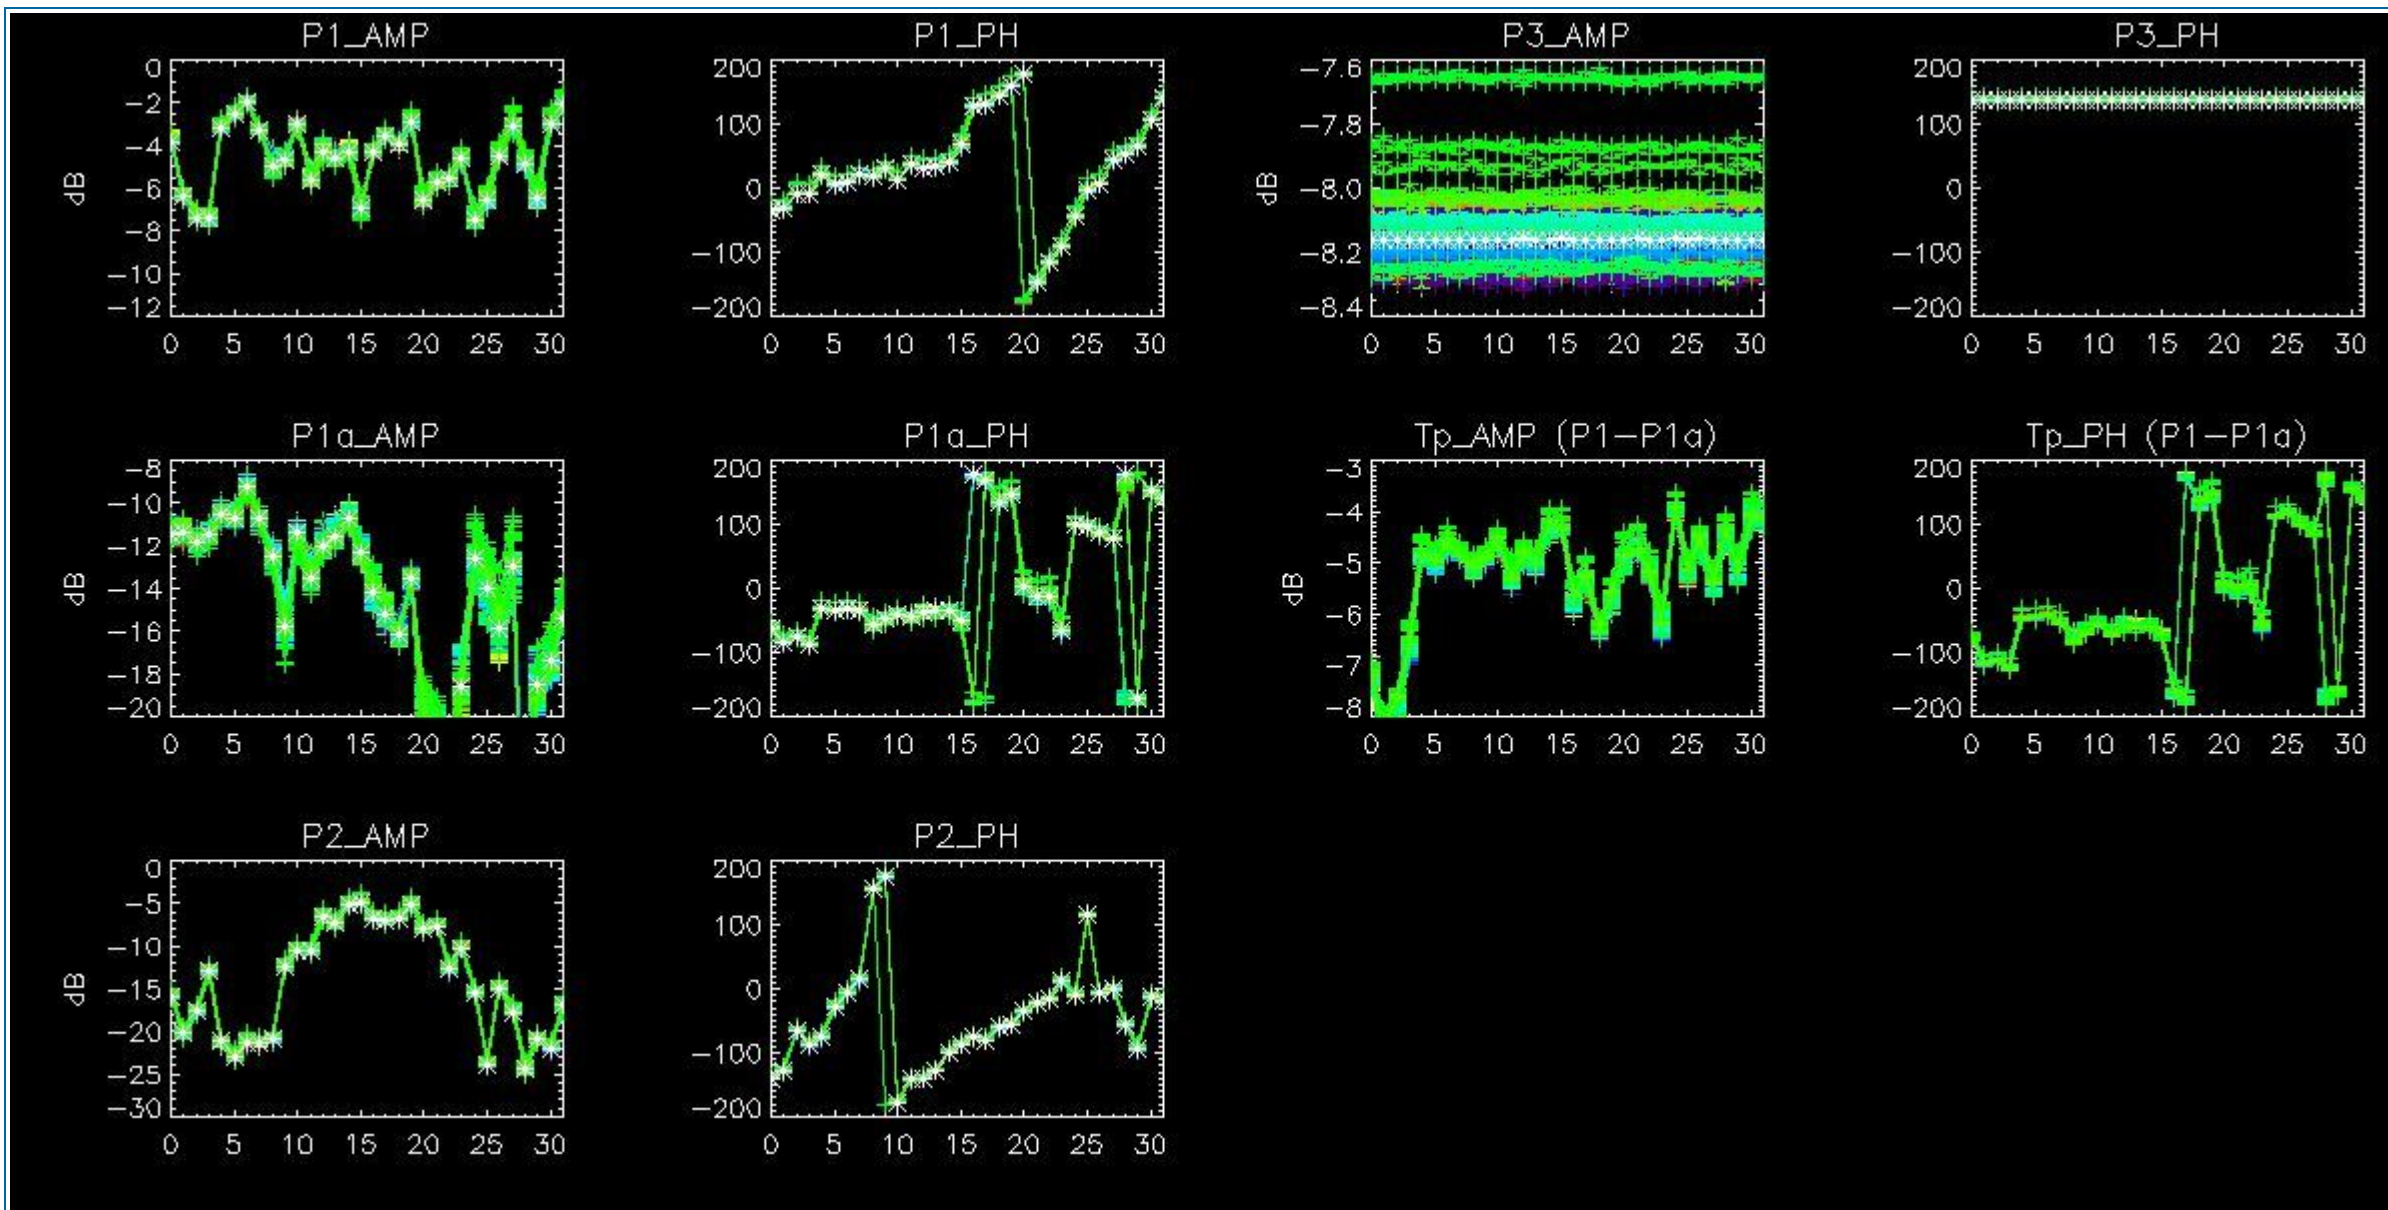


5 - DOPPLER ANALYSIS

5.1 - Analysis for WVS IS2 V/V

5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]




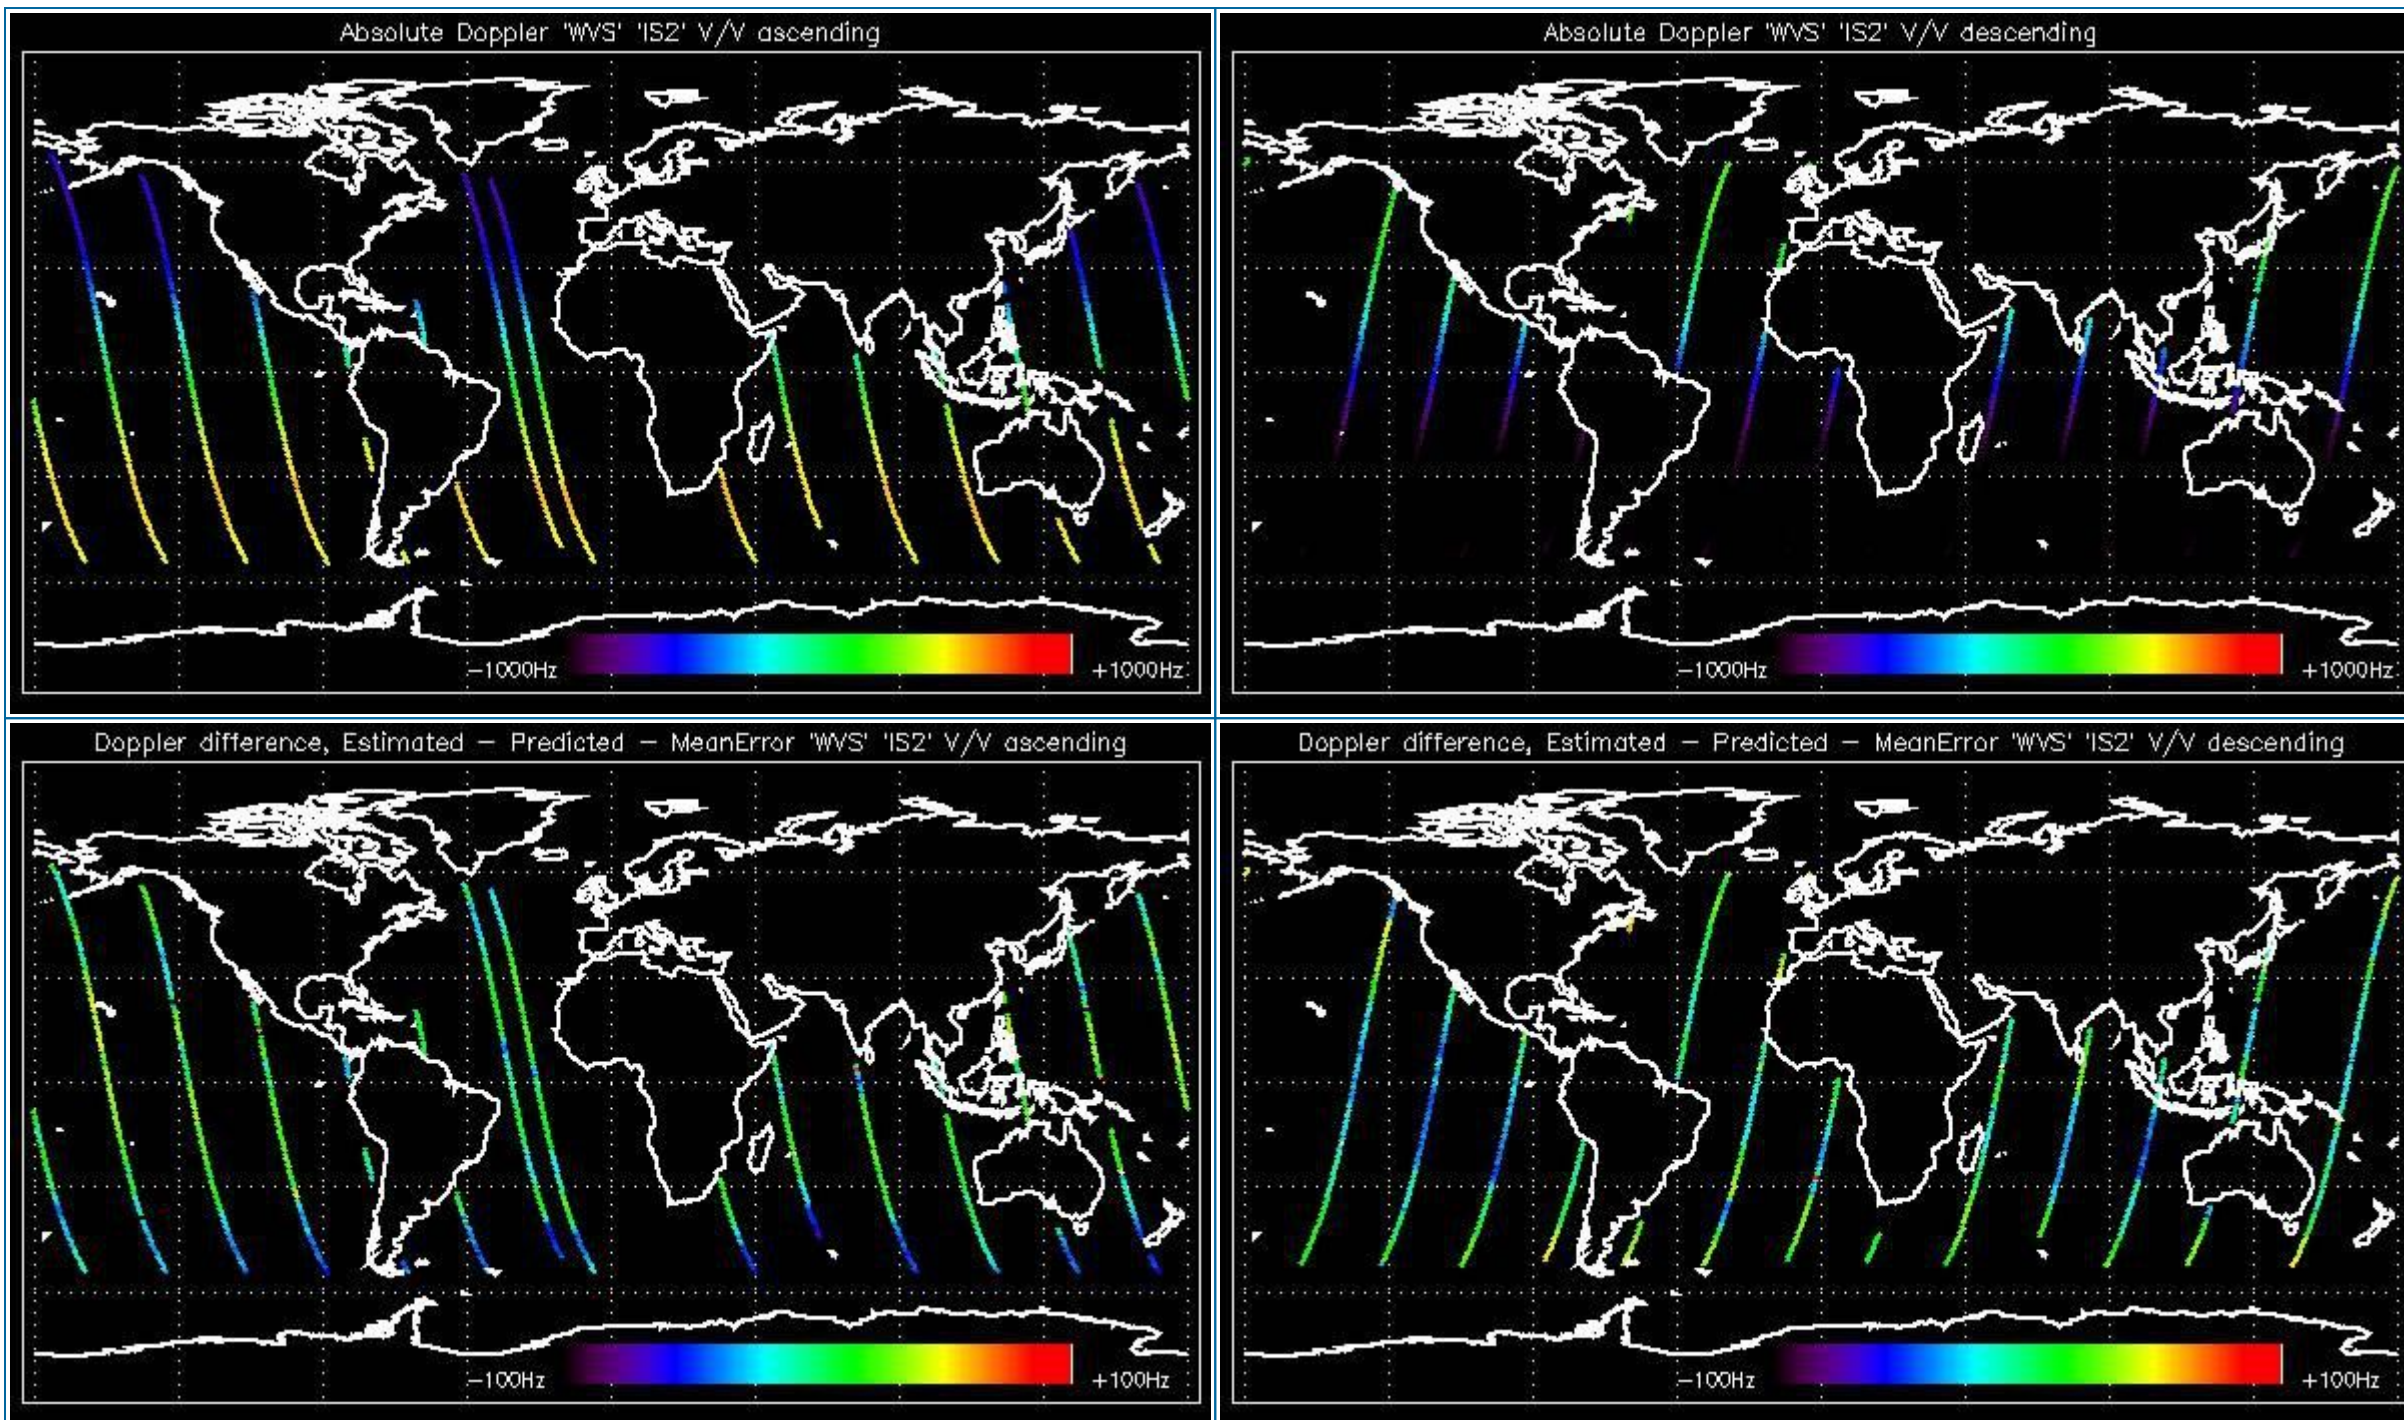

5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



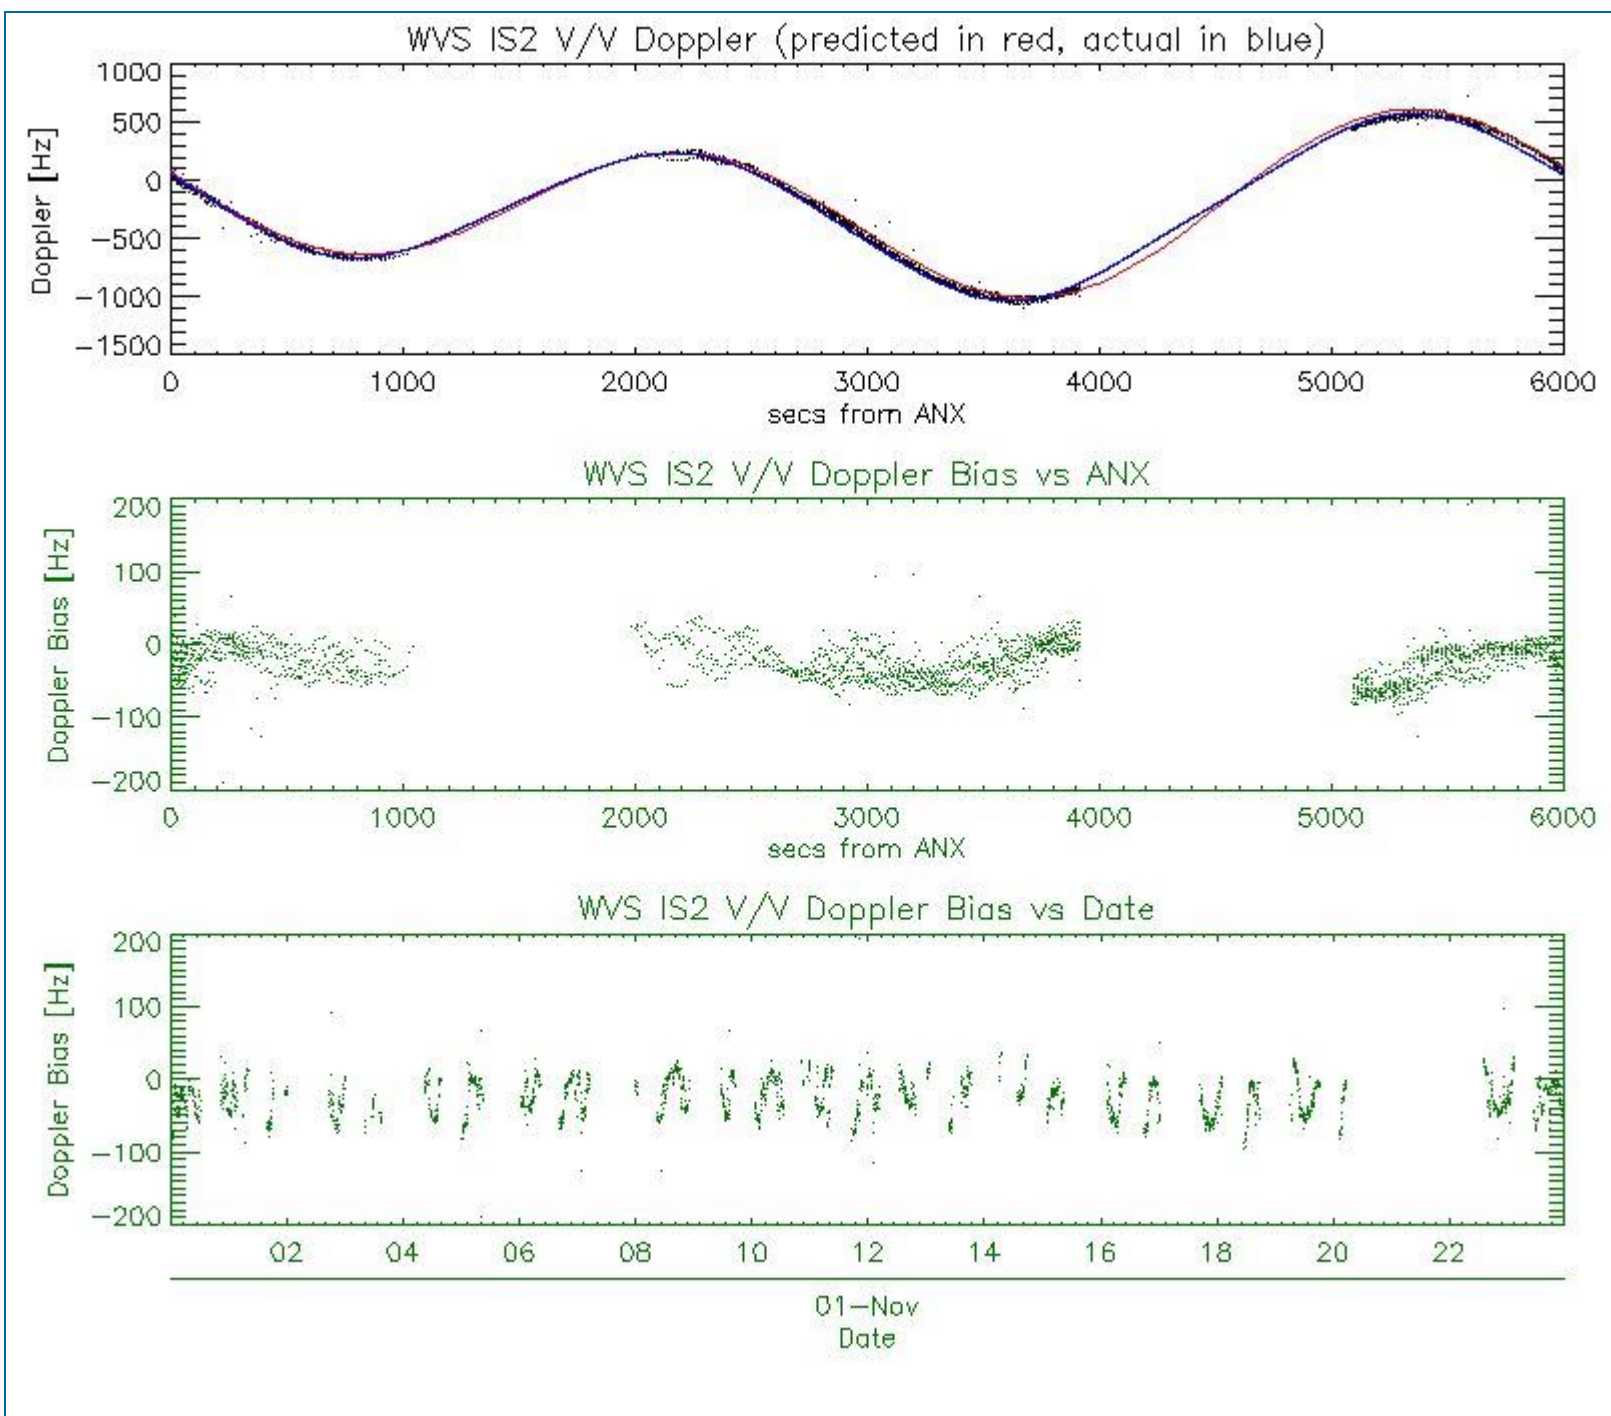


5.2 - Analysis for GM1 SS1 H/H

5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




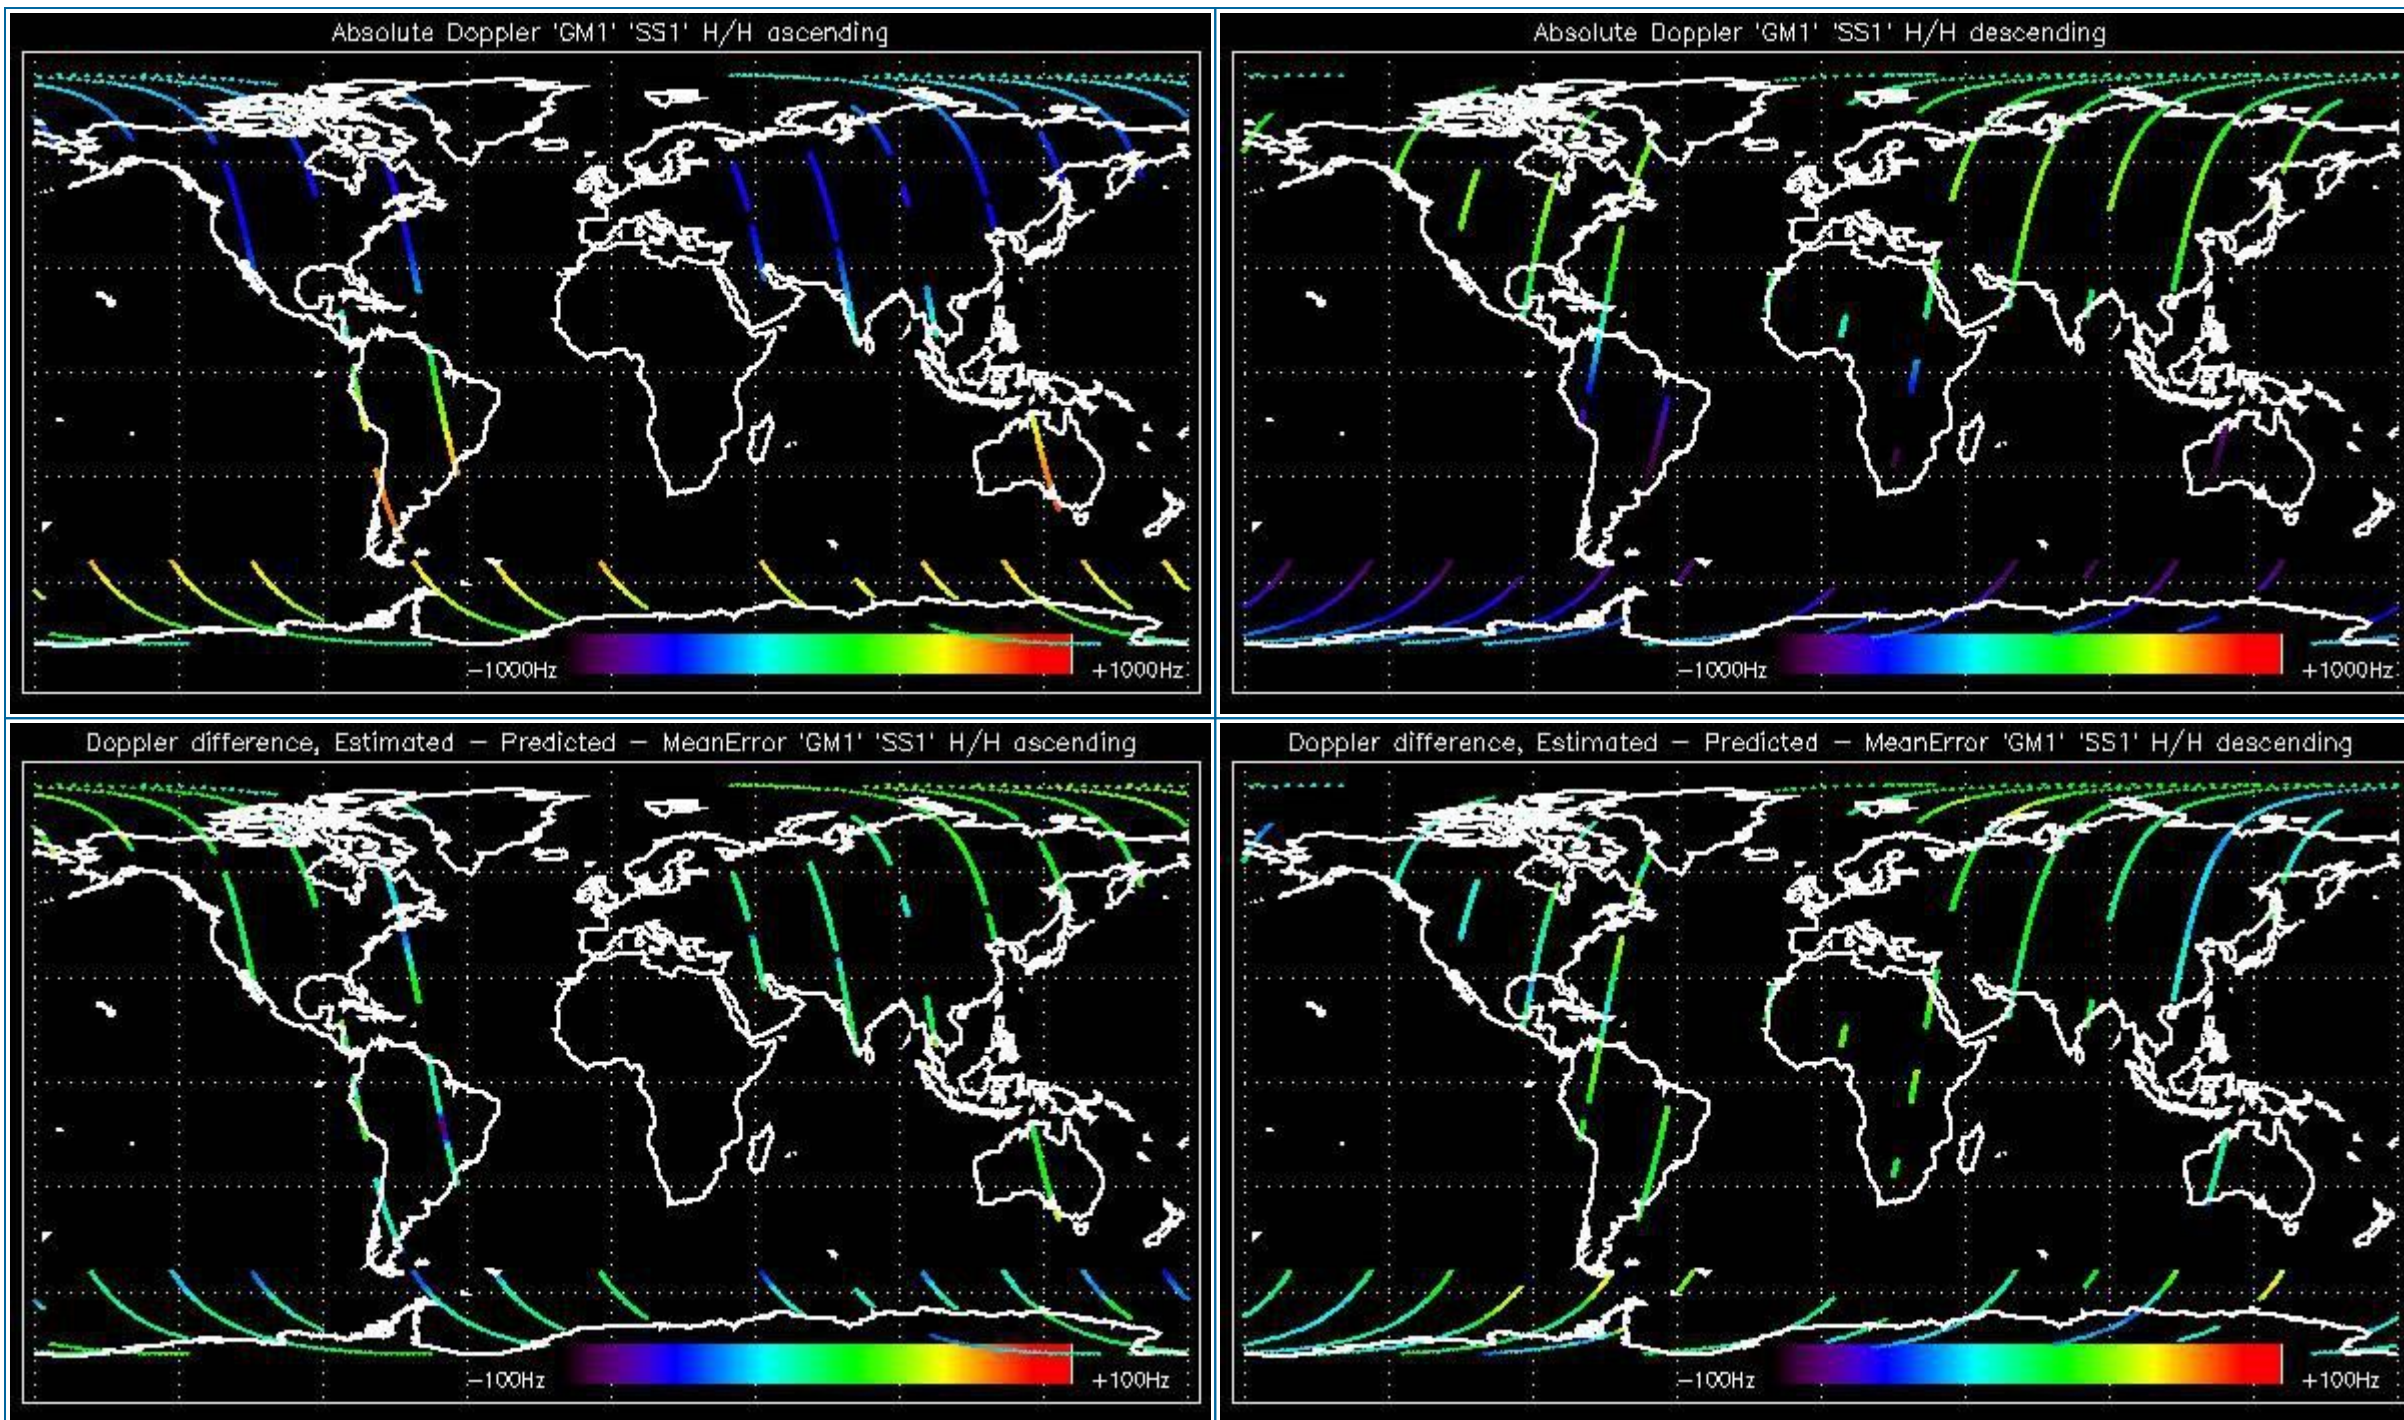

5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




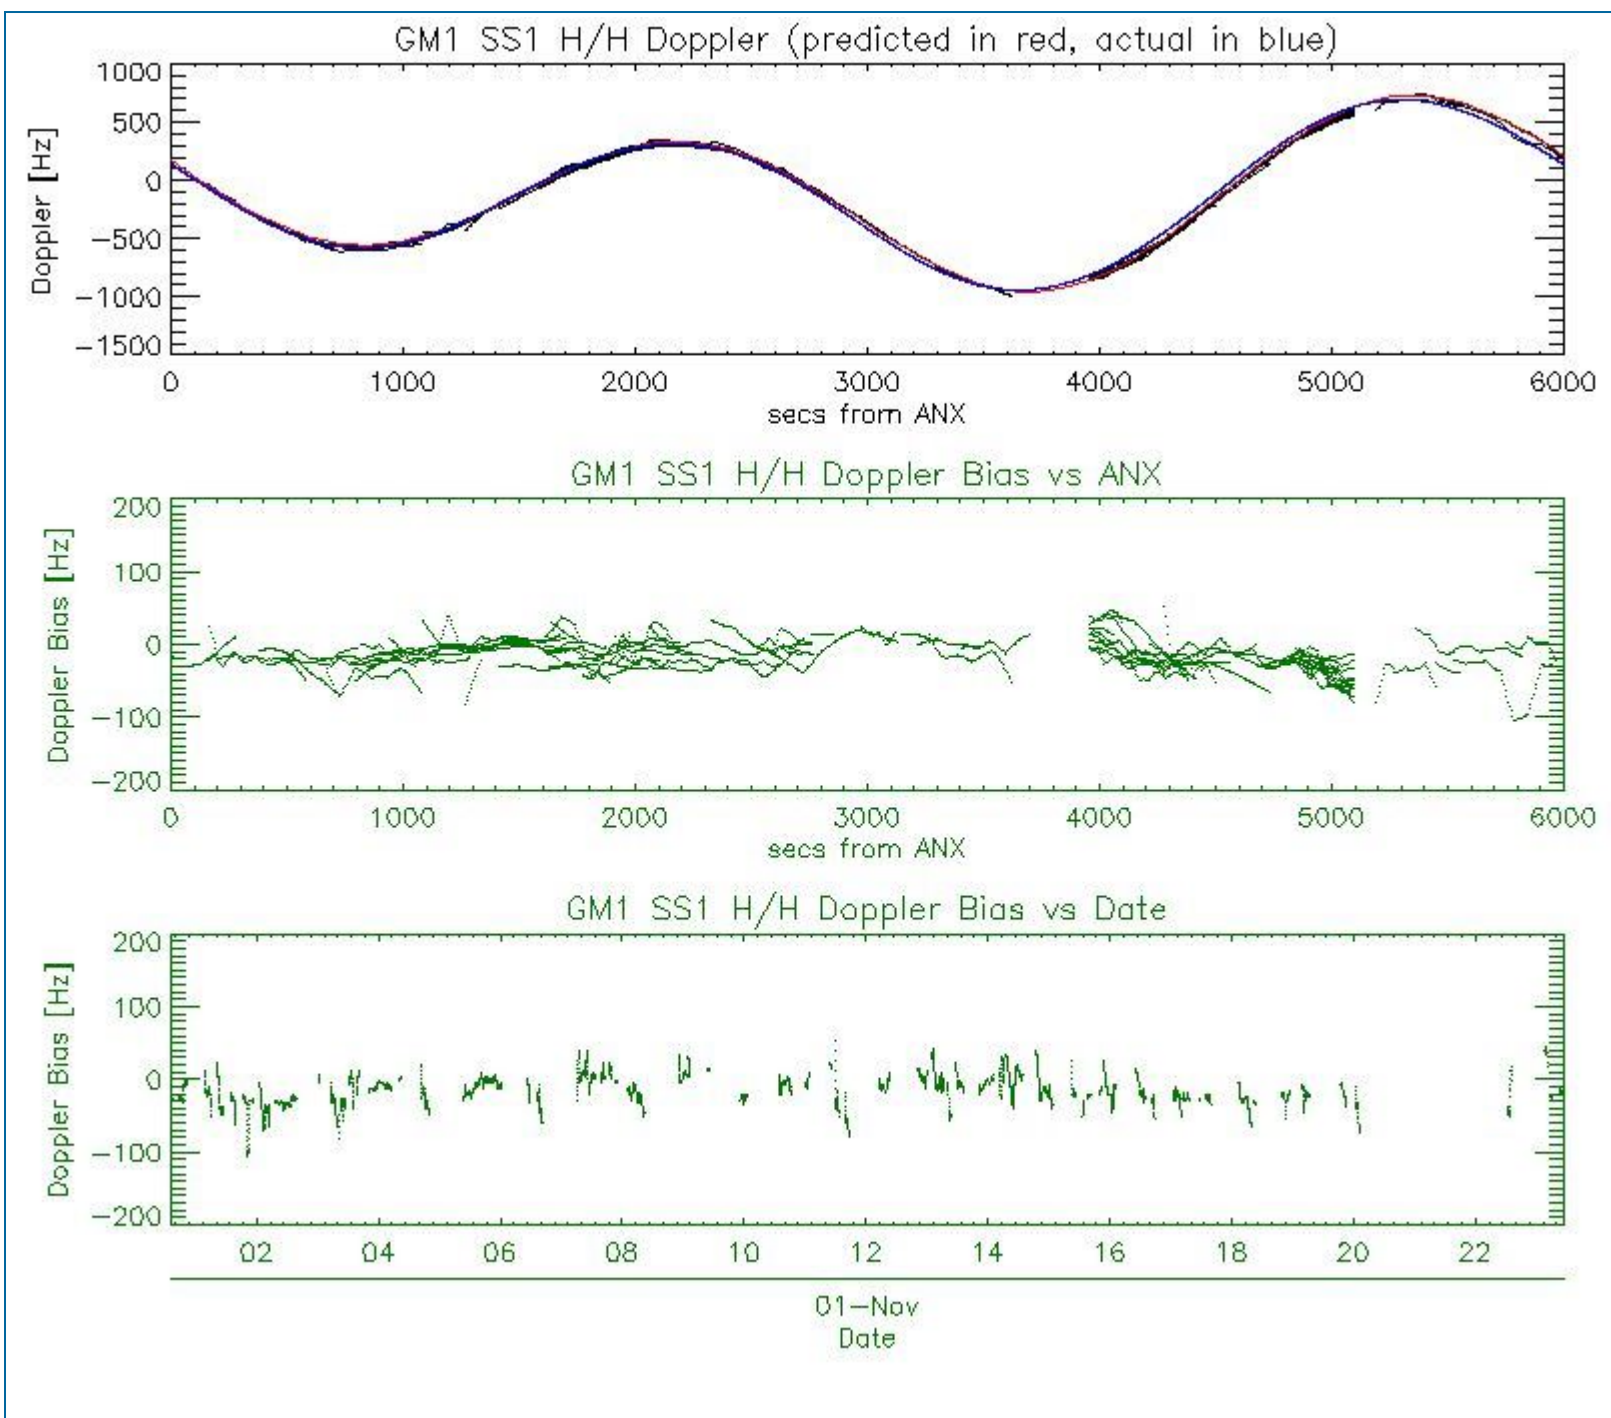

5.3 - Doppler JUMPS Analysis for WSM

[[BACK TO MENU](#)]



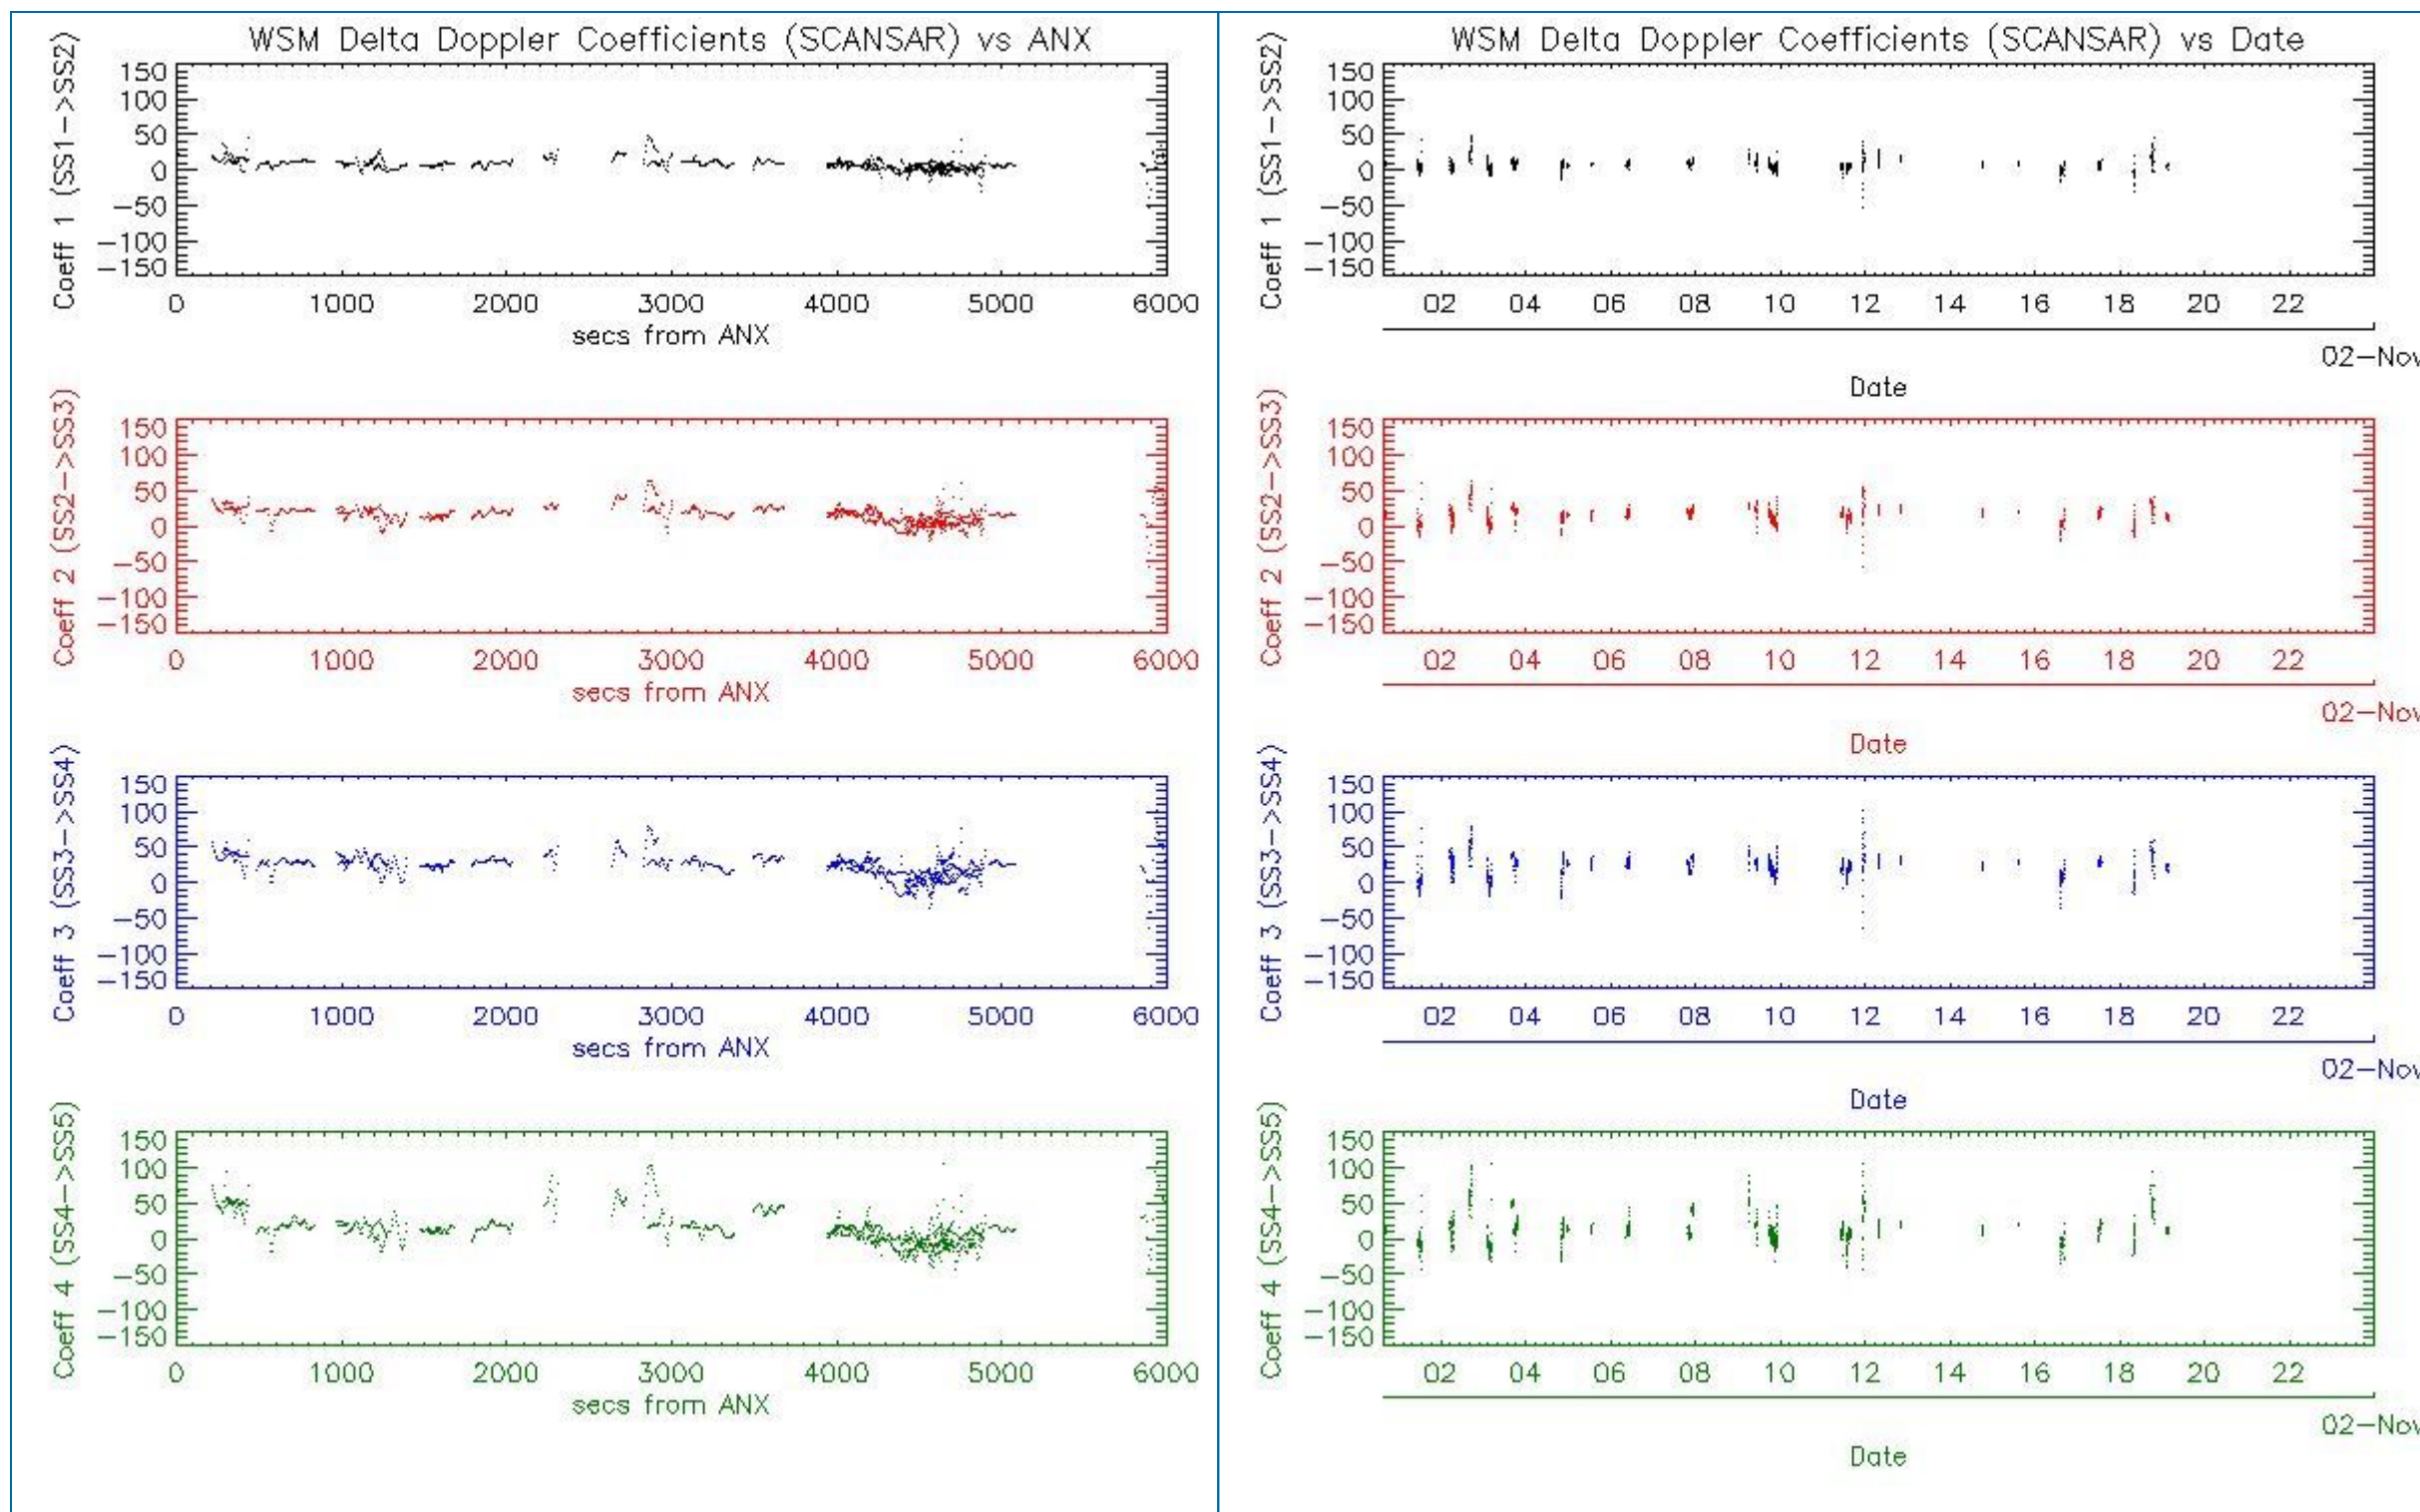



6 - CHIRP ANALYSIS

6.1 - Analysis for WSM SS1 H/H

6.1.1 - ScaleFactor

[[BACK TO MENU](#)]





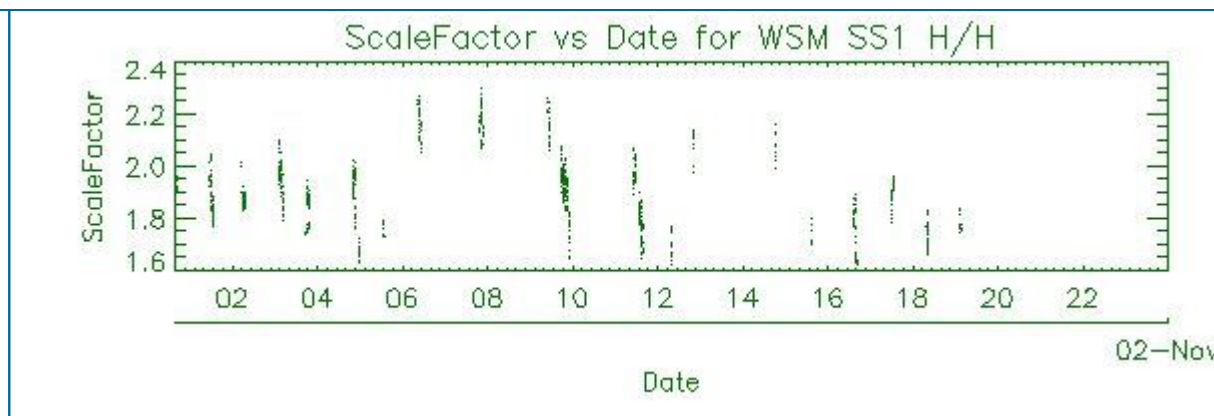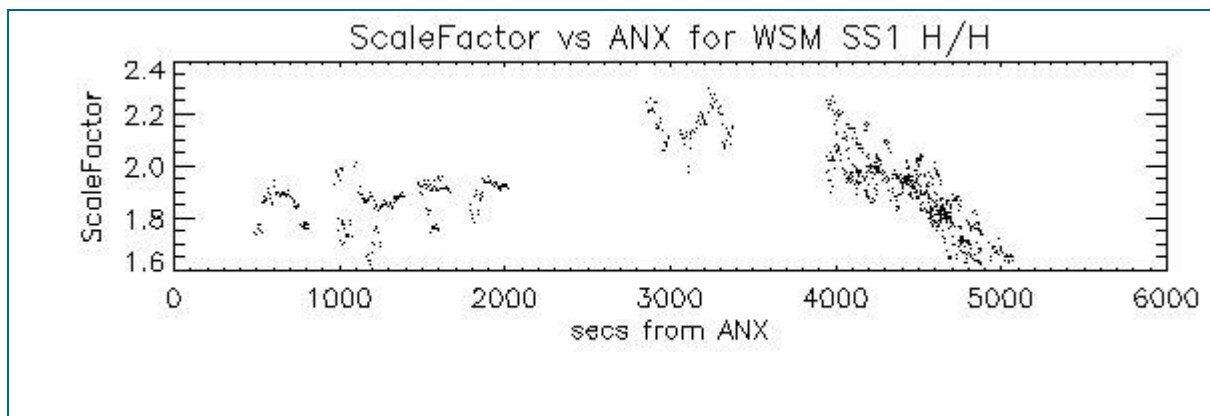

6.2 - Analysis for WSM SS1 V/V

6.2.1 - ScaleFactor

[[BACK TO MENU](#)]


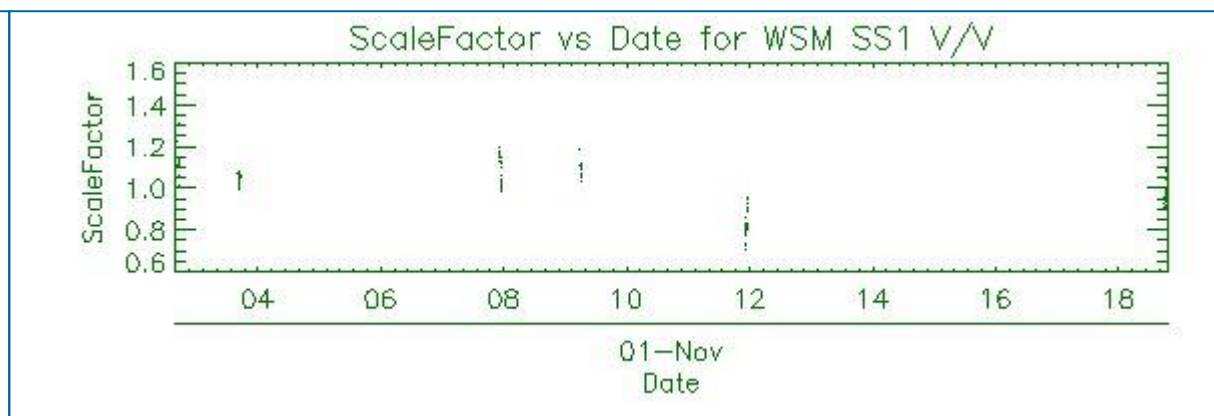
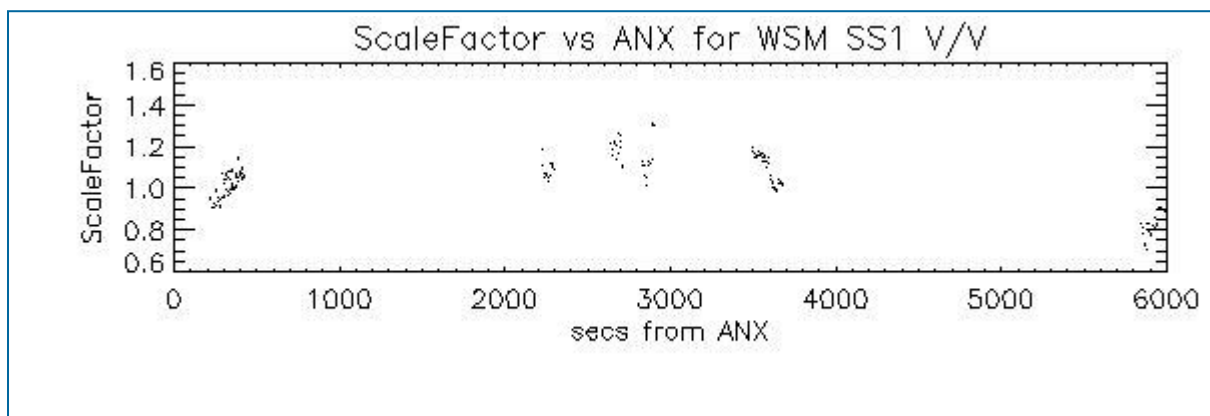


7 - RAW DATA ANALYSIS

7.1 - Analysis for WVS

[[BACK TO MENU](#)]

--	--	--

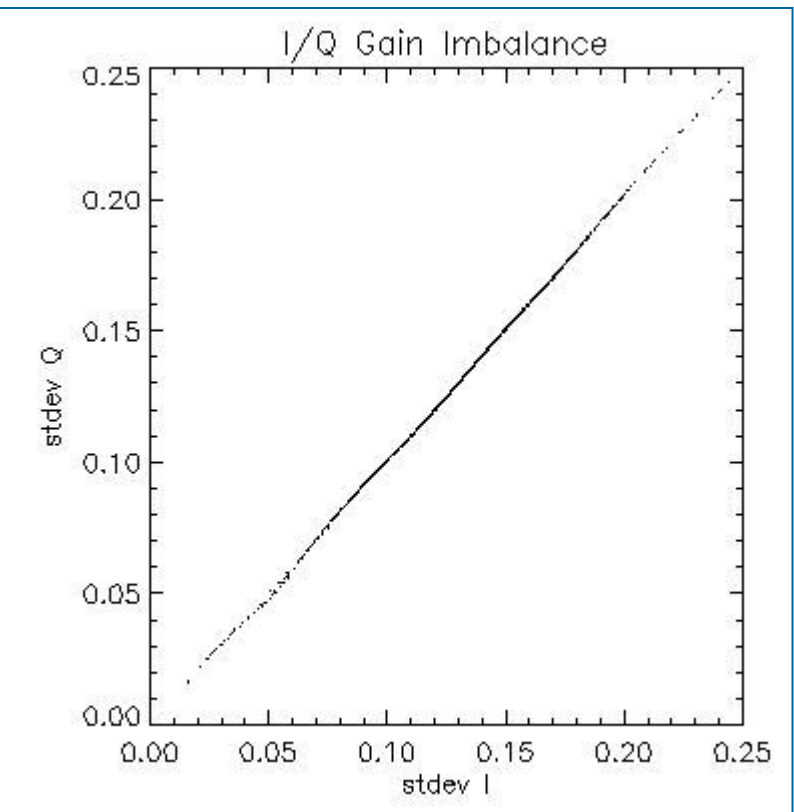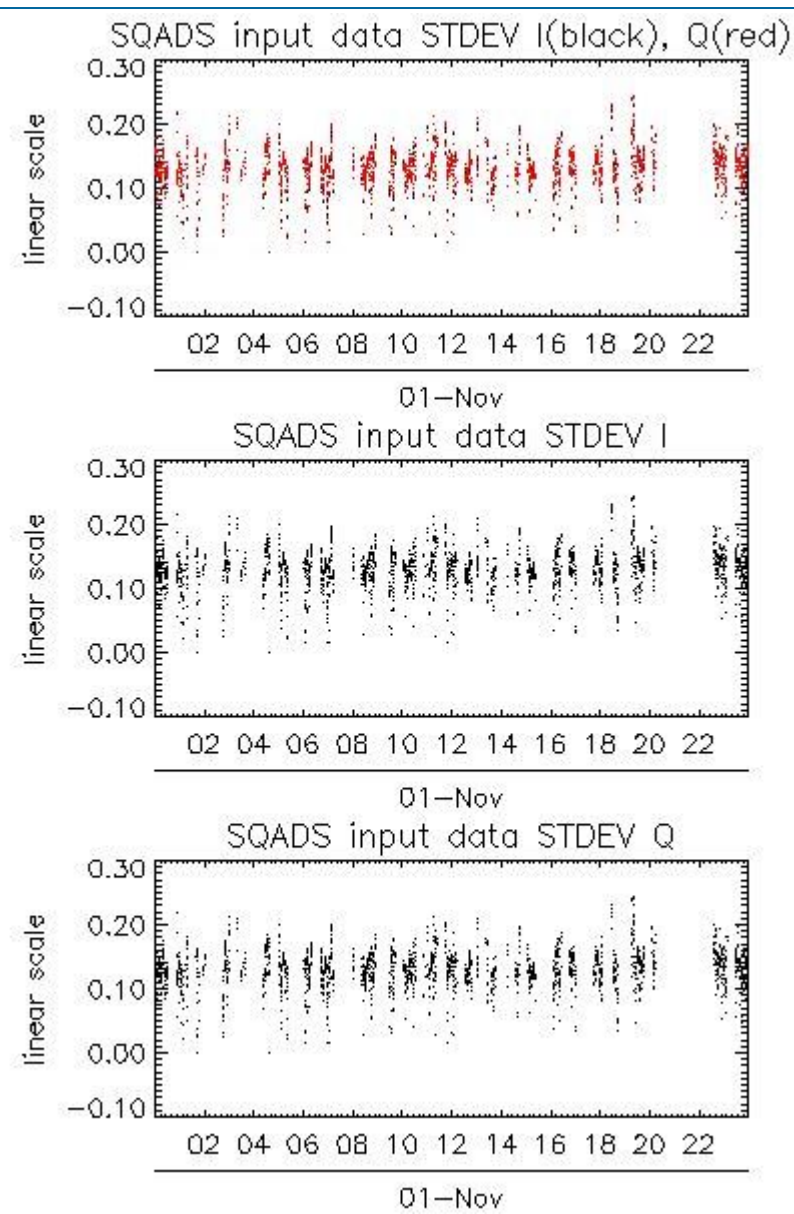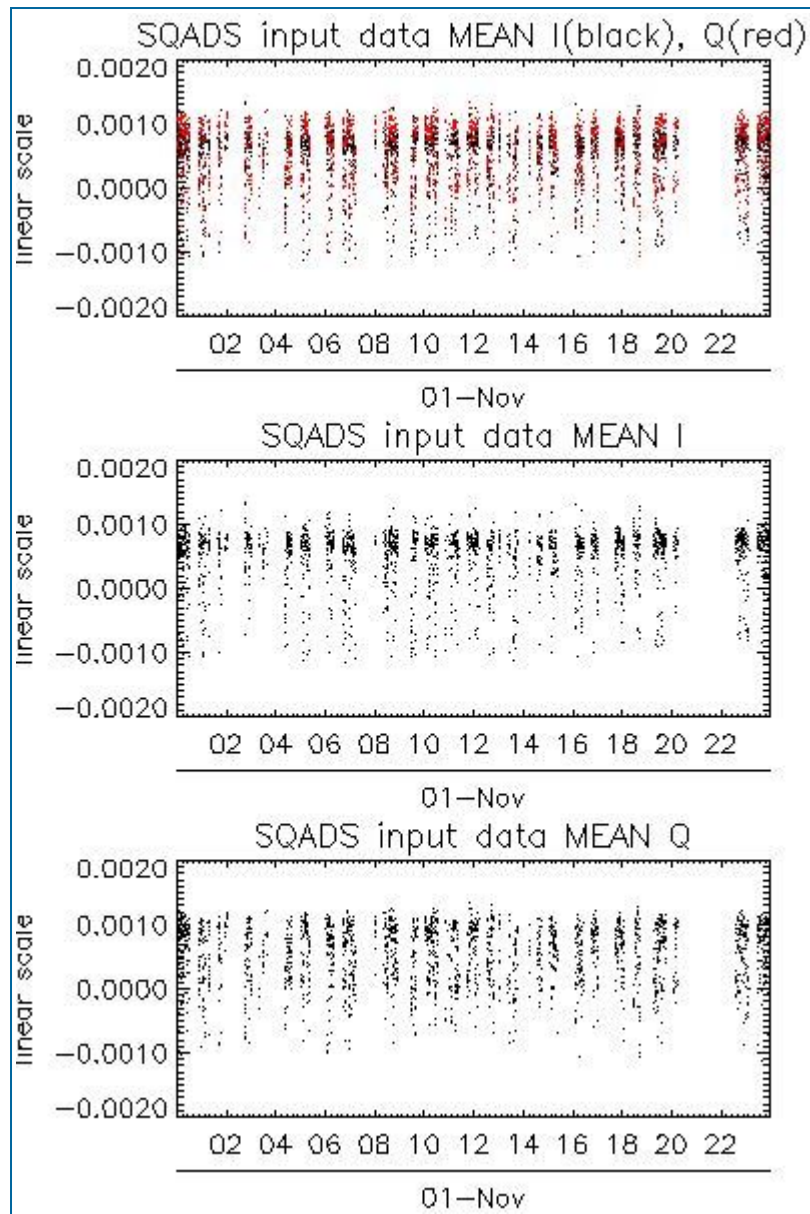


Channel	Statistics	DSS-B
MEAN I	mean	0.000498706
	stdev	2.09902e-07
MEAN Q	mean	0.000549072
	stdev	2.25107e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.130724
	stdev	0.000930534
STDEV Q	mean	0.131054
	stdev	0.000941420

7.2 - Analysis for IMM

[[BACK TO MENU](#)]

--	--	--

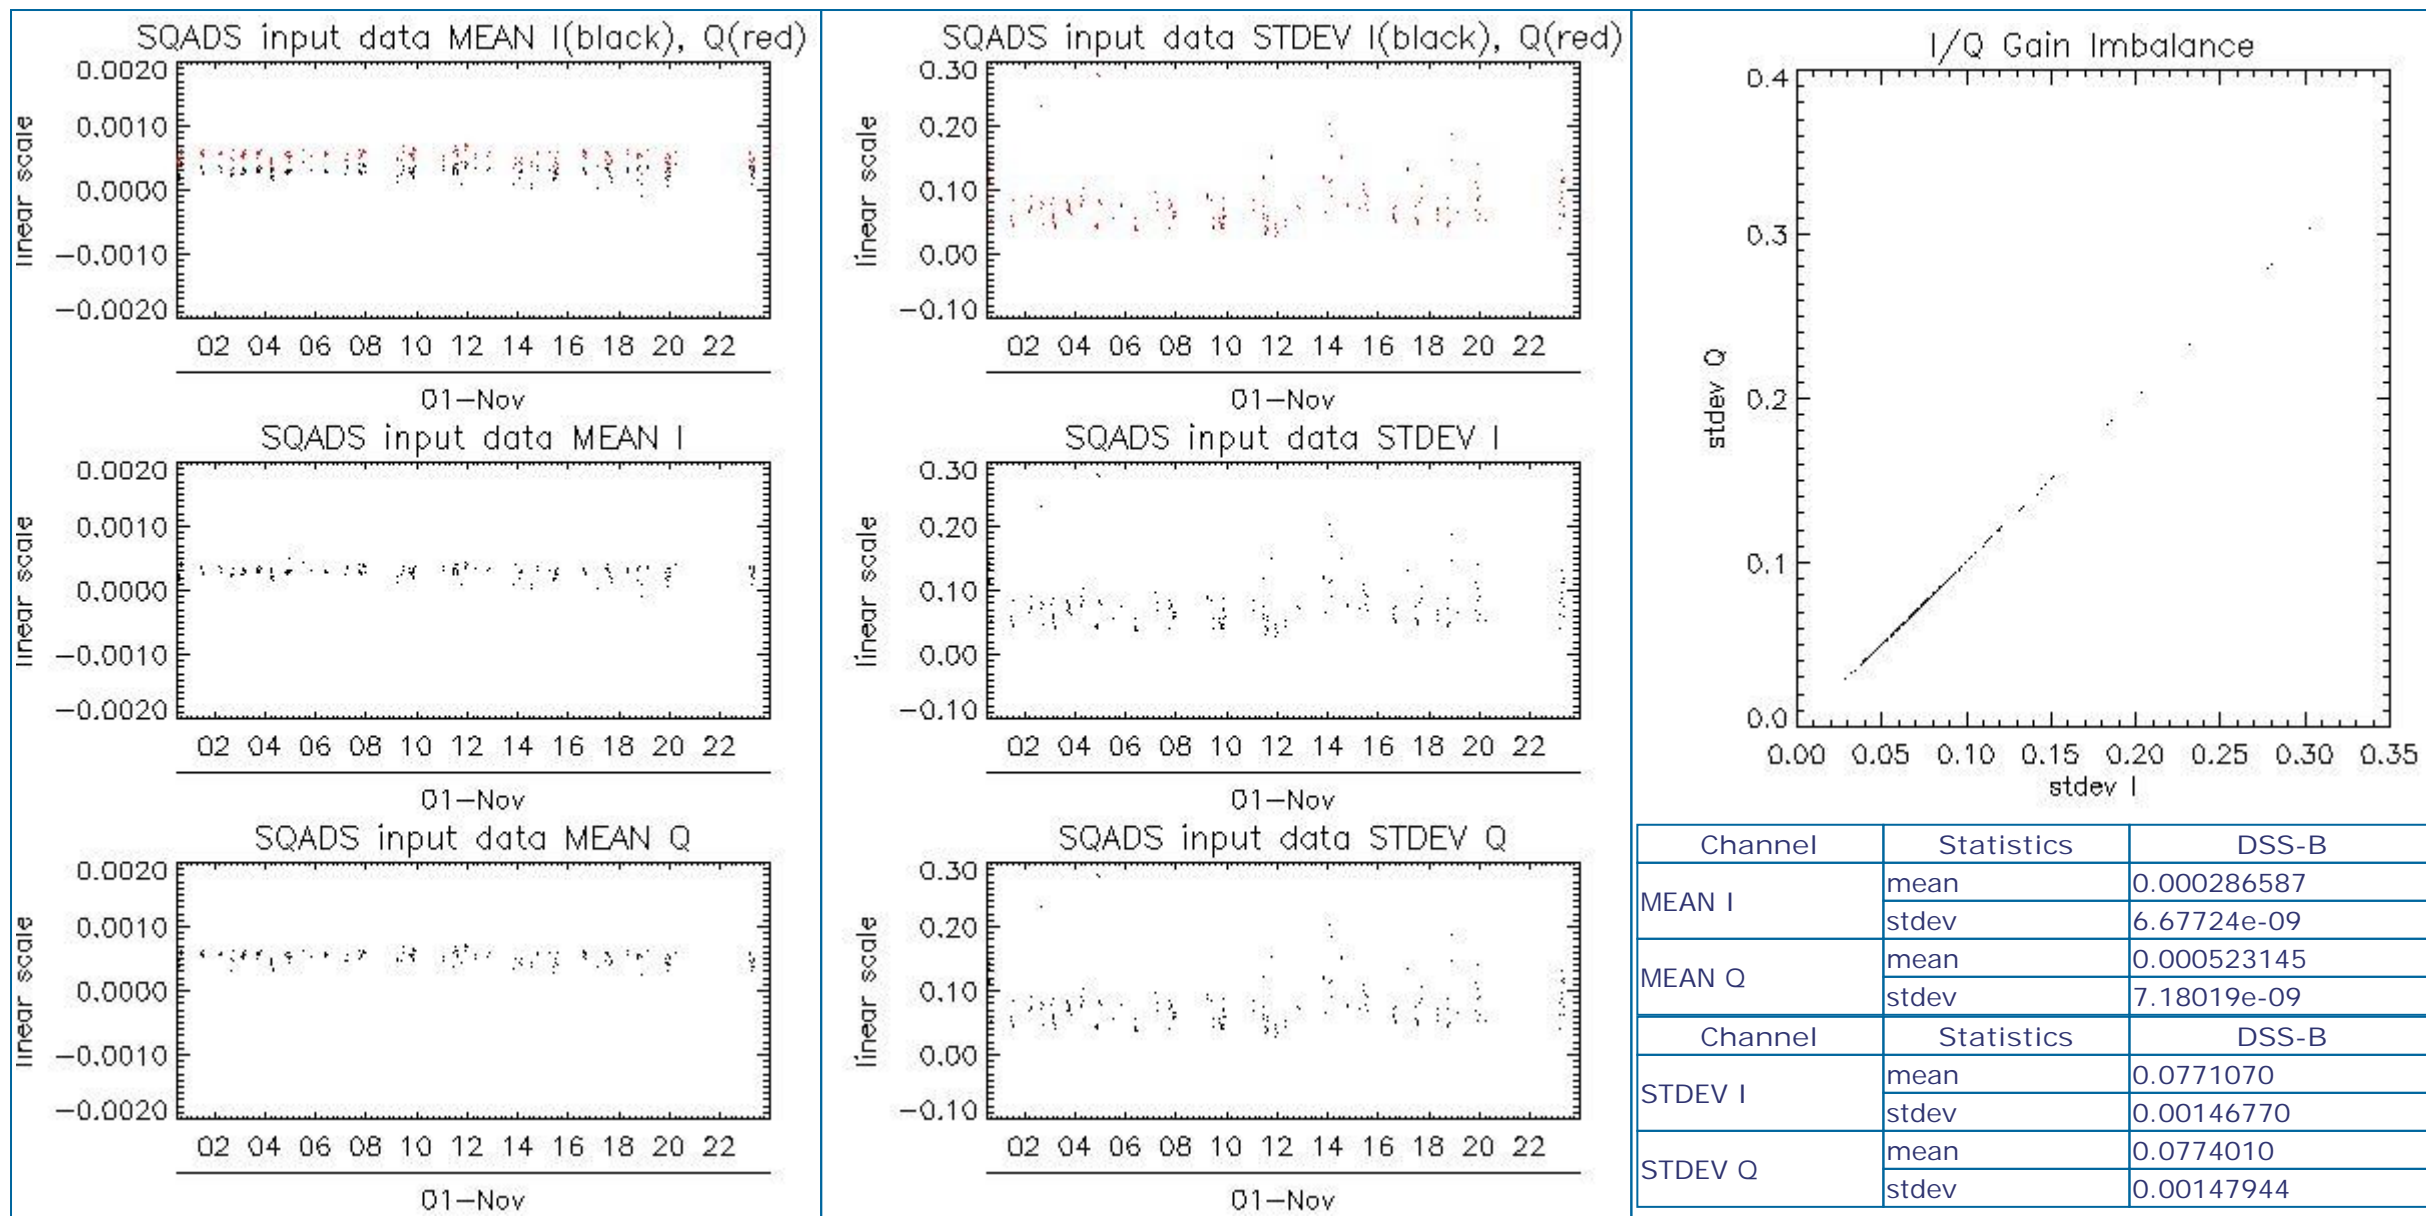



8 - TELEMETRY ANALYSIS

Processing Center	Product	Gaps	Missing lines
PDE	ASA_WSM_1PNPDE20081101_153620_00000612073_00269_34892_7817.N1	3	1015
PDE	ASA_WSM_1PNPDE20081101_184443_00000912073_00271_34894_7955.N1	0	32

8.1 - Number of Missing lines


[BACK TO MENU]



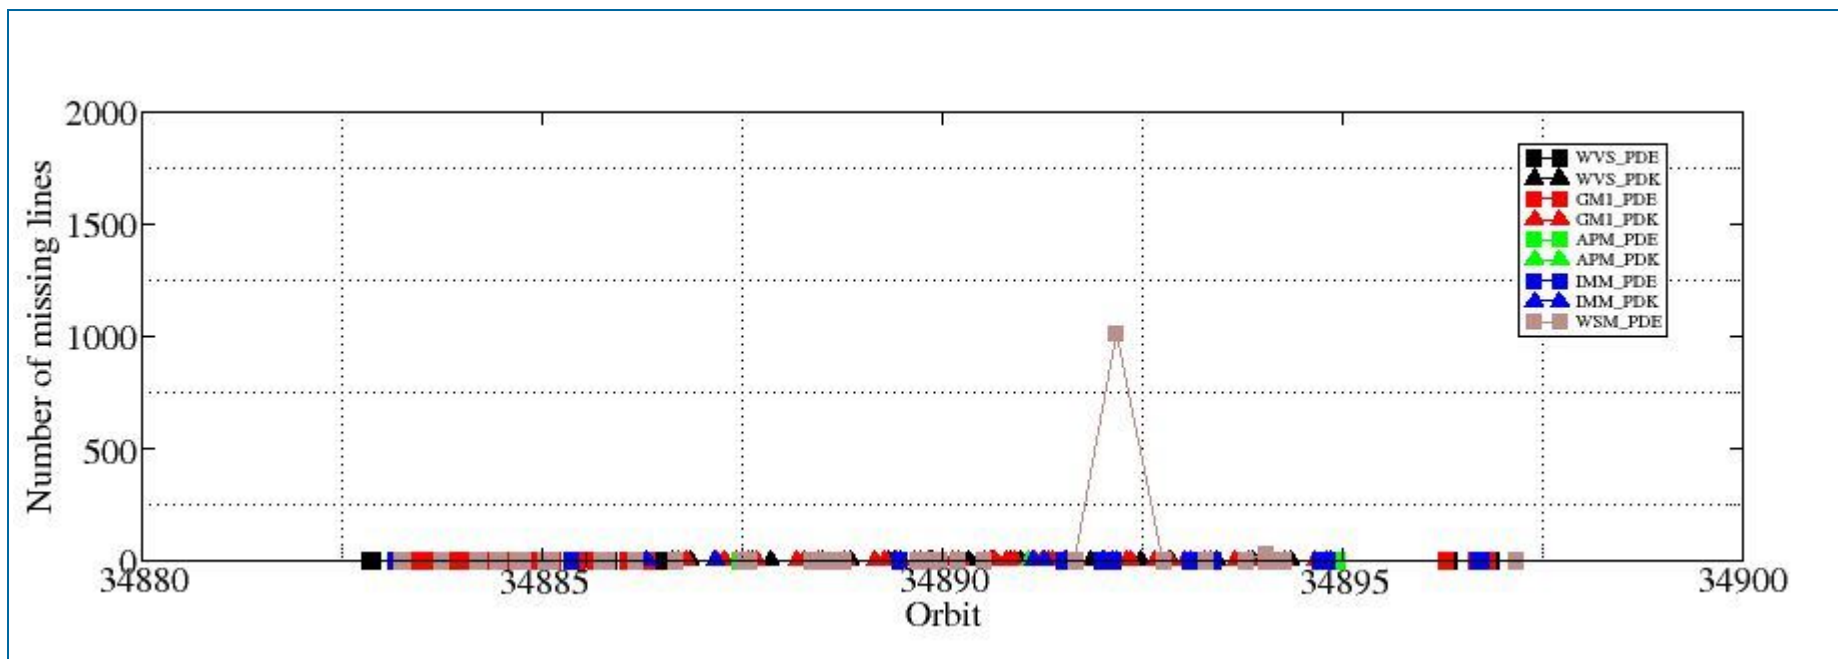

8.2 - Number of Gaps

[[BACK TO MENU](#)]

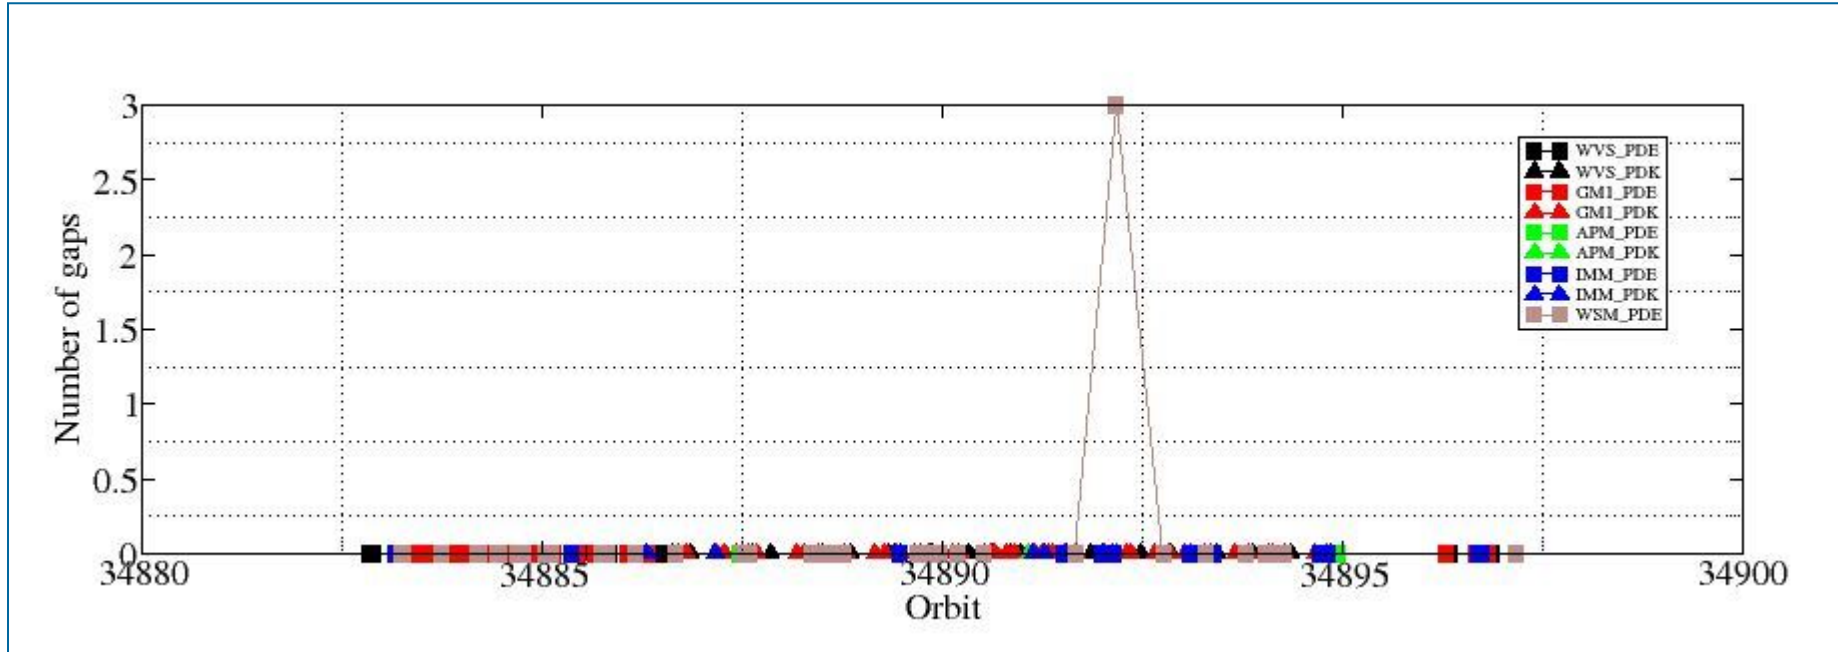

ASAR DAILY REPORT for 081101
#####

MODE: DAILY
ANALYSIS: ALL
DATE: YESTERDAY

Analysis will be performed from 2008-11-01 00:00:00 to 2008-11-01 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/081101/

DATA SUMMARY

Summary will be performed from 2008-11-01 00:00:00 to 2008-11-01 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/081101/DATA_SUMMARY

Creating directory ./RESULTS/DAILY/081101/DATA_SUMMARY...
Writing file ./RESULTS/DAILY/081101/DATA_SUMMARY/Data_summary.html...

Getting WVS products list from 2008-11-01 00:00:00 to 2008-11-01 23:59:59...
Writing file ./RESULTS/DAILY/081101/DATA_SUMMARY/List_WVS_products_used.xls...
Writing file ./RESULTS/DAILY/081101/DATA_SUMMARY/List_WVS_products_used.txt...

Getting GM1 products list from 2008-11-01 00:00:00 to 2008-11-01 23:59:59...
Writing file ./RESULTS/DAILY/081101/DATA_SUMMARY/List_GM1_products_used.xls...
Writing file ./RESULTS/DAILY/081101/DATA_SUMMARY/List_GM1_products_used.txt...

Getting APM products list from 2008-11-01 00:00:00 to 2008-11-01 23:59:59...
Writing file ./RESULTS/DAILY/081101/DATA_SUMMARY/List_APM_products_used.xls...
Writing file ./RESULTS/DAILY/081101/DATA_SUMMARY/List_APM_products_used.txt...

Getting IMM products list from 2008-11-01 00:00:00 to 2008-11-01 23:59:59...
Writing file ./RESULTS/DAILY/081101/DATA_SUMMARY/List_IMM_products_used.xls...
Writing file ./RESULTS/DAILY/081101/DATA_SUMMARY/List_IMM_products_used.txt...

Getting WSM products list from 2008-11-01 00:00:00 to 2008-11-01 23:59:59...
Writing file ./RESULTS/DAILY/081101/DATA_SUMMARY/List_WSM_products_used.xls...
Writing file ./RESULTS/DAILY/081101/DATA_SUMMARY/List_WSM_products_used.txt...

Getting MS products list from 2008-11-01 00:00:00 to 2008-11-01 23:59:59...
Writing file ./RESULTS/DAILY/081101/DATA_SUMMARY/List_MS_products_used.xls...
Writing file ./RESULTS/DAILY/081101/DATA_SUMMARY/List_MS_products_used.txt...

DATA SUMMARY completed
#####

AUXILIARY FILES ANALYSIS

Analysis will be performed from 2008-11-01 00:00:00 to 2008-11-01 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/081101/AUXILIARY

Creating directory ./RESULTS/DAILY/081101/AUXILIARY...

Looking for the IECF operational ADFs list...



Found list 20081101_030000_current_3_IECF_ADFs.txt...
Extracting ADFs...

ASA_CON_AXVIEC20080710_132557_20070204_165113_20081231_000000
ASA_INS_AXVIEC20071218_083603_20070307_060000_20081231_000000
ASA_XCH_AXVIEC20051219_162547_20020301_000000_20081231_000000
ASA_XCA_AXVIEC20080710_133546_20070204_165113_20081231_000000

Writing file ./RESULTS/DAILY/081101/AUXILIARY/ASAR_ADFs_IECF_List3.html...
Writing file ./RESULTS/DAILY/081101/AUXILIARY/Auxiliary_files_summary.html...

Analysing WVS products...

Writing file ./RESULTS/DAILY/081101/AUXILIARY/Check_ADFs_WVS.xls...
Writing file ./RESULTS/DAILY/081101/AUXILIARY/Check_ADFs_WVS.txt...

ASA_WVS_1PNPDE20081101_000258_000016492073_00259_34882_6834.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_005149_000009752073_00260_34883_6839.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_011502_000002852073_00260_34883_6849.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_013934_000001192073_00260_34883_6842.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_014034_000003302073_00260_34883_6980.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_015717_000002092073_00261_34884_6987.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_024343_000010042073_00261_34884_6992.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_030013_000000152073_00261_34884_7102.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_032010_000000452073_00261_34884_7097.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_032744_000001492073_00261_34884_7111.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_033603_000000892073_00262_34885_7134.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_042151_000008992073_00262_34885_7141.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_043621_000001352073_00262_34885_7350.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_050037_000013192073_00262_34885_7388.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_060141_000009742073_00263_34886_7393.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_223523_000019342073_00273_34896_8058.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_232721_000001652073_00273_34896_8063.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20081101_232921_000017392073_00273_34896_8189.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_061741_000002252073_00263_34886_9287.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_064122_000018742073_00263_34886_9322.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_075936_000001352073_00264_34887_9398.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_082158_000019792073_00264_34887_9407.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_092741_000008842073_00265_34888_9539.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_100233_000018292073_00265_34888_9544.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_105138_000000602073_00266_34889_9670.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_105814_000001192073_00266_34889_9675.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_110521_000010792073_00266_34889_9684.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_114309_000000752073_00266_34889_9687.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_114558_000005242073_00266_34889_9692.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_115901_000007642073_00267_34890_9704.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_123214_000009892073_00267_34890_9817.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_130027_000002102073_00267_34890_9822.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_132345_000002102073_00267_34890_9827.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_133549_000005242073_00267_34890_9830.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_134539_000000442073_00268_34891_9842.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_141544_000001052073_00268_34891_9970.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_143429_000005852073_00268_34891_9975.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_150421_000007642073_00268_34891_9978.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_151843_000001942073_00268_34891_9989.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_160614_000011392073_00269_34892_0108.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_164457_000010042073_00269_34892_0122.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_174301_000013642073_00270_34893_0295.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_182822_000009442073_00270_34893_0307.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_191616_000017992073_00271_34894_0437.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20081101_200609_000004502073_00271_34894_0445.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing GM1 products...

Writing file ./RESULTS/DAILY/081101/AUXILIARY/Check_ADFs_GM1.xls...

Writing file ./RESULTS/DAILY/081101/AUXILIARY/Check_ADFs_GM1.txt...

ASA_GM1_1PNPDE20081101_003537_000000722073_00260_34883_6827.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_004246_000003682073_00260_34883_6829.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_005010_000000962073_00260_34883_6831.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_010855_000003622073_00260_34883_6836.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_012031_000004282073_00260_34883_6846.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_013410_000003202073_00260_34883_6844.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_014642_000006342073_00260_34883_6982.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_020124_000007062073_00261_34884_6989.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_021837_000012262073_00261_34884_7053.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_030107_000000842073_00261_34884_7094.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_031245_000004412073_00261_34884_7106.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_032138_000002592073_00261_34884_7104.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_032600_000001022073_00261_34884_7099.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_033058_000003022073_00261_34884_7113.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_033822_000001262073_00262_34885_7108.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_034947_000014022073_00262_34885_7196.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_041937_000001322073_00262_34885_7143.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_044143_000004592073_00262_34885_7354.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_052313_000005922073_00263_34886_7352.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_053444_000007732073_00263_34886_7356.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_054824_000007972073_00263_34886_7390.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_223149_000002112073_00273_34896_8045.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_230818_000001502073_00273_34896_8047.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_231323_000000902073_00273_34896_8049.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20081101_232308_000002472073_00273_34896_8060.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_062636_000001442073_00263_34886_9284.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_063557_000003202073_00263_34886_9294.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_071541_000005552073_00264_34887_9319.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_072347_000005862073_00264_34887_9389.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_073824_000002772073_00264_34887_9391.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_074626_000001572073_00264_34887_9393.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_075339_000000842073_00264_34887_9395.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_080513_000010032073_00264_34887_9481.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_085534_000006222073_00265_34888_9404.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_090449_000001202073_00265_34888_9534.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_092326_000001022073_00265_34888_9536.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_095610_000003802073_00265_34888_9541.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_103349_000007372073_00266_34889_9551.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_104452_000001142073_00266_34889_9672.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_110051_000001692073_00266_34889_9677.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_112407_000001022073_00266_34889_9679.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_112925_000002232073_00266_34889_9681.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_113947_000001992073_00266_34889_9689.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_121224_000003382073_00267_34890_9694.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_122000_000001992073_00267_34890_9701.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_125112_000004412073_00267_34890_9812.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_125835_000001082073_00267_34890_9814.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_130442_000007182073_00267_34890_9819.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_131929_000002532073_00267_34890_9824.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_132803_000004652073_00267_34890_9834.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_135046_000001202073_00268_34891_9832.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_135332_000006702073_00268_34891_9844.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_140332_000001322073_00268_34891_9963.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_141103_000002772073_00268_34891_9965.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_141806_000008032073_00268_34891_9967.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_143255_00000902073_00268_34891_9972.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_144637_000010622073_00268_34891_0065.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_152243_000002352073_00269_34892_9986.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_153310_000000962073_00269_34892_9984.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_153725_000002412073_00269_34892_9996.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_154914_000001442073_00269_34892_0101.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_155418_000007122073_00269_34892_0103.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_162554_000006042073_00269_34892_0105.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

```
ASA_GM1_1PNPDK20081101_164134_000001992073_00269_34892_0110.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_170232_000004652073_00270_34893_0112.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_171105_000004222073_00270_34893_0119.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_172736_000001142073_00270_34893_0288.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_173442_000002892073_00270_34893_0290.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_180630_000007792073_00270_34893_0292.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_182221_000000902073_00270_34893_0297.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_184827_000002592073_00271_34894_0299.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_185404_000002292073_00271_34894_0309.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_190811_000004832073_00271_34894_0432.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_194706_000003322073_00271_34894_0434.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20081101_200216_000002292073_00271_34894_0447.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

Analysing APM products...

Writing file ./RESULTS/DAILY/081101/AUXILIARY/Check_ADFs_APM.xls...
Writing file ./RESULTS/DAILY/081101/AUXILIARY/Check_ADFs_APM.txt...

```
ASA_APM_1PNPDE20081101_074303_000001822073_00264_34887_7539.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20081101_201512_000000602073_00271_34894_7931.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDK20081101_134800_000000432073_00268_34891_9913.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

Analysing IMM products...

Writing file ./RESULTS/DAILY/081101/AUXILIARY/Check_ADFs_IMM.xls...
Writing file ./RESULTS/DAILY/081101/AUXILIARY/Check_ADFs_IMM.txt...

```
ASA_IMM_1PNPDE20081101_003117_000002432073_00260_34883_6975.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_003117_000002502073_00260_34883_7251.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_003651_000000942073_00260_34883_6932.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_024127_000000372073_00261_34884_6963.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_041308_000003632073_00262_34885_7235.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_041308_000003782073_00262_34885_7249.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_045442_000001632073_00262_34885_7347.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_110339_000000962073_00266_34889_7707.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_114503_000000482073_00266_34889_7784.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_143127_000000772073_00268_34891_7841.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_151745_000000522073_00268_34891_7835.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_152640_000001832073_00269_34892_7875.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_152640_000003762073_00269_34892_7877.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_153042_000000602073_00269_34892_7865.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_153244_000000132073_00269_34892_7869.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_171015_000000382073_00270_34893_7855.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_172927_000000392073_00270_34893_7879.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_173932_000002022073_00270_34893_7919.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_185246_000000672073_00271_34894_7925.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_195237_000001792073_00271_34894_7951.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_195614_000001222073_00271_34894_7957.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_195614_000003532073_00271_34894_7959.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_195917_000000592073_00271_34894_7945.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_200117_000000502073_00271_34894_7949.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_231050_000001412073_00273_34896_8142.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20081101_231450_000004882073_00273_34896_8162.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20081101_054736_000000372073_00263_34886_0218.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20081101_071308_000001412073_00264_34887_9380.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20081101_135244_000000362073_00268_34891_9921.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20081101_140547_000003022073_00268_34891_9943.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

Analysing WSM products...



Writing file ./RESULTS/DAILY/081101/AUXILIARY/Check_ADFs_WSM.xls...
 Writing file ./RESULTS/DAILY/081101/AUXILIARY/Check_ADFs_WSM.txt...

ASA_WSM_1PNPDE20081101_003904_000002142073_00260_34883_7452.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_004018_000001392073_00260_34883_6977.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_012743_000003732073_00260_34883_6969.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_021317_000001352073_00261_34884_7090.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_021317_000003122073_00261_34884_7472.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_021627_000001212073_00261_34884_7091.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_023907_000000912073_00261_34884_6984.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_024212_000000922073_00261_34884_7055.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_030450_000003482073_00261_34884_7146.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_031111_000000922073_00261_34884_7228.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_034034_000001532073_00262_34885_7233.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_034348_000001352073_00262_34885_7319.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_034348_000003542073_00262_34885_7474.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_034658_000001632073_00262_34885_7320.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_044926_000001352073_00262_34885_7464.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_044926_000002932073_00262_34885_7505.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_045337_000000422073_00262_34885_7345.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_045747_000001652073_00262_34885_7450.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_053310_000000732073_00263_34886_7329.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_062202_000002692073_00263_34886_7480.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_074908_000002502073_00264_34887_7553.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_075509_000001902073_00264_34887_7545.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_091432_000000912073_00265_34888_7590.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_092510_000001532073_00265_34888_7655.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_094315_000003732073_00265_34888_7778.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_094315_000005082073_00265_34888_7797.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_095113_000001152073_00265_34888_7679.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_095125_000000182073_00265_34888_7766.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_095336_000001472073_00265_34888_7748.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_112551_000002082073_00266_34889_7772.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_113313_000003912073_00266_34889_7815.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_115531_000002072073_00266_34889_7813.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_121807_000001092073_00267_34890_7776.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_124938_000000922073_00267_34890_7787.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_144503_000000912073_00268_34891_7871.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_153620_000000612073_00269_34892_7817.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_163600_000003302073_00269_34892_7873.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_173019_000002502073_00270_34893_7921.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_181931_000001652073_00270_34893_7917.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_184443_000000912073_00271_34894_7955.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_184550_000000732073_00271_34894_7903.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_184550_000001532073_00271_34894_7953.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_184805_000000182073_00271_34894_7907.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_190634_000000922073_00271_34894_7923.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20081101_235904_000002262073_00274_34897_8323.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

AUXILIARY FILES ANALYSIS completed
 #####

MODULE STEPPING ANALYSIS
 #####
 Analysis will be performed from 2008-11-01 00:00:00 to 2008-11-01 23:59:59
 Results will be exported to the directory: ./RESULTS/DAILY/081101/MODULE_STEPPING

Creating directory ./RESULTS/DAILY/081101/MODULE_STEPPING...
 Creating directory ./RESULTS/DAILY/081101/MODULE_STEPPING/FIRST_REFERENCE...
 Creating directory ./RESULTS/DAILY/081101/MODULE_STEPPING/SECOND_REFERENCE...
 Creating directory ./RESULTS/DAILY/081101/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...
 Deleting old files...

Creating images comparing with second reference...

Exporting results to the directory ../../RESULTS/DAILY/081101/MODULE_STEPPING/SECOND_REFERENCE...

Polarization: H
Reference product: ASA_MS__0PNPDK20050922_062651_000000152041_00034_18625_0041.N1
Test product: ASA_MS__0PNPDE20081101_222916_000000162073_00273_34896_0350.N1
H
H
../../RESULTS/DAILY/081101/MODULE_STEPPING/SECOND_REFERENCE/TGH_20081101_222916-20050922_062651.png
../../RESULTS/DAILY/081101/MODULE_STEPPING/SECOND_REFERENCE/TPH_20081101_222916-20050922_062651.png
../../RESULTS/DAILY/081101/MODULE_STEPPING/SECOND_REFERENCE/RGH_20081101_222916-20050922_062651.png
../../RESULTS/DAILY/081101/MODULE_STEPPING/SECOND_REFERENCE/RPH_20081101_222916-20050922_062651.png

Polarization: V
Reference product: ASA_MS__0PNPDK20050923_055514_000000152041_00048_18639_0042.N1
Test product: ASA_MS__0PNPDE20081031_033411_000000162073_00247_34870_0348.N1
V
V
../../RESULTS/DAILY/081101/MODULE_STEPPING/SECOND_REFERENCE/TGV_20081031_033411-20050923_055514.png
../../RESULTS/DAILY/081101/MODULE_STEPPING/SECOND_REFERENCE/TPV_20081031_033411-20050923_055514.png
../../RESULTS/DAILY/081101/MODULE_STEPPING/SECOND_REFERENCE/RGV_20081031_033411-20050923_055514.png
../../RESULTS/DAILY/081101/MODULE_STEPPING/SECOND_REFERENCE/RPV_20081031_033411-20050923_055514.png

Creating images comparing with previous product reference...

Exporting results to the directory ../../RESULTS/DAILY/081101/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Polarization: H
Reference product: ASA_MS__0PNPDE20081101_030234_000000162073_00261_34884_0349.N1
Test product: ASA_MS__0PNPDE20081101_222916_000000162073_00273_34896_0350.N1
H
H
../../RESULTS/DAILY/081101/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGH_20081101_222916-20081101_030234.png
../../RESULTS/DAILY/081101/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPH_20081101_222916-20081101_030234.png
../../RESULTS/DAILY/081101/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGH_20081101_222916-20081101_030234.png
../../RESULTS/DAILY/081101/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPH_20081101_222916-20081101_030234.png

Polarization: V
Reference product: ASA_MS__0PNPDE20081029_043726_000000162073_00219_34842_0346.N1
Test product: ASA_MS__0PNPDE20081031_033411_000000162073_00247_34870_0348.N1
V
V
../../RESULTS/DAILY/081101/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGV_20081031_033411-20081029_043726.png
../../RESULTS/DAILY/081101/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPV_20081031_033411-20081029_043726.png
../../RESULTS/DAILY/081101/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGV_20081031_033411-20081029_043726.png
../../RESULTS/DAILY/081101/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPV_20081031_033411-20081029_043726.png

MODULE_STEPPING ANALYSIS completed
#####

CALIBRATION PULSES ANALYSIS

Creating directory ./RESULTS/DAILY/081101/CALIBRATION_PULSES...

ALL ROWS Analysis will be performed from 2008-11-01 00:00:00 to 2008-11-01 23:59:59

Analysing products WVS IS2 V/V



Writing image ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Calibration_pulses_all_rows_WVS_IS2_VV.png...
 Analysing products GM1 SS3 H/H
 Writing image ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Calibration_pulses_all_rows_GM1_SS3_HH.png...

 TEMPORAL EVOLUTION Analysis will be performed from 2008-11-01 00:00:00 to 2008-11-01 23:59:59

Analysing products WVS IS2 V/V
 Getting calibration pulses data for WVS IS2 V/V from 2008-11-01 00:00:00 to 2008-11-01 23:59:59. Rows: 1/5/9/13/17/21/25/29
 Writing file ./RESULTS/DAILY/081101/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2008-11-01_1.dat...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_1.png...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2008-11-01 00:00:00 to 2008-11-01 23:59:59. Rows: 2/6/10/14/18/22/26/30
 Writing file ./RESULTS/DAILY/081101/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2008-11-01_2.dat...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_2.png...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2008-11-01 00:00:00 to 2008-11-01 23:59:59. Rows: 3/7/11/15/19/23/27/31
 Writing file ./RESULTS/DAILY/081101/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2008-11-01_3.dat...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_3.png...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2008-11-01 00:00:00 to 2008-11-01 23:59:59. Rows: 4/8/12/16/20/24/28/32
 Writing file ./RESULTS/DAILY/081101/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2008-11-01_4.dat...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_4.png...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_4.png...

Analysing products GM1 SS3 H/H
 Getting calibration pulses data for GM1 SS3 H/H from 2008-11-01 00:00:00 to 2008-11-01 23:59:59. Rows: 1/5/9/13/17/21/25/29
 Writing file ./RESULTS/DAILY/081101/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2008-11-01_1.dat...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_1.png...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_1.png...

Getting calibration pulses data for GM1 SS3 H/H from 2008-11-01 00:00:00 to 2008-11-01 23:59:59. Rows: 2/6/10/14/18/22/26/30
 Writing file ./RESULTS/DAILY/081101/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2008-11-01_2.dat...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_2.png...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2008-11-01 00:00:00 to 2008-11-01 23:59:59. Rows: 3/7/11/15/19/23/27/31
 Writing file ./RESULTS/DAILY/081101/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2008-11-01_3.dat...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_3.png...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2008-11-01 00:00:00 to 2008-11-01 23:59:59. Rows: 4/8/12/16/20/24/28/32
 Writing file ./RESULTS/DAILY/081101/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2008-11-01_4.dat...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_4.png...
 Writing ../../RESULTS/DAILY/081101//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_4.png...

CALIBRATION PULSES ANALYSIS completed
 #####

DOPPLER ANALYSIS
 #####

Creating directory ./RESULTS/DAILY/081101/DOPPLER...

DOPPLER ANX Analysis will be performed from 2008-11-01 00:00:00 to 2008-11-01 23:59:59

Analysing products WVS IS2 V/V
Getting doppler data for WVS IS2 V/V from 2008-11-01 00:00:00 to 2008-11-01 23:59:59...
Writing file ./RESULTS/DAILY/081101/DOPPLER/Doppler_data_WVS_IS2_VV_2008-11-01.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/081101/DOPPLER/DOPPLER_ANX_WVS_IS2_VV.png...

Analysing products GM1 SS1 H/H
Getting doppler data for GM1 SS1 H/H from 2008-11-01 00:00:00 to 2008-11-01 23:59:59...
Writing file ./RESULTS/DAILY/081101/DOPPLER/Doppler_data_GM1_SS1_HH_2008-11-01.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/081101/DOPPLER/DOPPLER_ANX_GM1_SS1_HH.png...

DOPPLER JUMPS Analysis will be performed on WSM products from 2008-11-01 00:00:00 to 2008-11-01 23:59:59

Analysing by default products WSM
Getting doppler jumps data for WSM from 2008-11-01 00:00:00 to 2008-11-01 23:59:59...
Writing file ./RESULTS/DAILY/081101/DOPPLER/Doppler_Jumps_data_WSM_2008-11-01.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/081101/DOPPLER/DOPPLER_JUMPS_ANX_WSM.png...
Writing file ../../RESULTS/DAILY/081101/DOPPLER/DOPPLER_JUMPS_Date_WSM.png...

DOPPLER MAP Analysis will be performed from 2008-11-01 00:00:00 to 2008-11-01 23:59:59

Analysing products WVS IS2 V/V
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -22.564768 Hz
Writing file ../../RESULTS/DAILY/081101/DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_desc.jpg...
Writing file ../../RESULTS/DAILY/081101/DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_desc.jpg...

Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -25.896639 Hz
Writing file ../../RESULTS/DAILY/081101/DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_asc.jpg...
Writing file ../../RESULTS/DAILY/081101/DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_asc.jpg...

Analysing products GM1 SS1 H/H
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -10.006832 Hz
Writing file ../../RESULTS/DAILY/081101/DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_desc.jpg...
Writing file ../../RESULTS/DAILY/081101/DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_desc.jpg...

Loading predicted doppler values....

Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -21.447942 Hz
Writing file ../../RESULTS/DAILY/081101//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_asc.jpg...
Writing file ../../RESULTS/DAILY/081101//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_asc.jpg...

DOPPLER ANALYSIS completed
#####

CHIRP ANALYSIS

Creating directory ./RESULTS/DAILY/081101/CHIRP...

CHIRP Analysis will be performed from 2008-11-01 00:00:00 to 2008-11-01 23:59:59

Analysing products WSM SS1 H/H

Getting ScaleFactor data for WSM SS1 H/H from 2008-11-01 00:00:00 to 2008-11-01 23:59:59...
Writing file ./RESULTS/DAILY/081101/CHIRP/ScaleFactor_data_WSM_SS1_HH_2008-11-01.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/081101/CHIRP/ScaleFactor_ANX_WSM_SS1_HH.png...
Writing file ../../RESULTS/DAILY/081101/CHIRP/ScaleFactor_DATE_WSM_SS1_HH.png...

Analysing products WSM SS1 V/V

Getting ScaleFactor data for WSM SS1 V/V from 2008-11-01 00:00:00 to 2008-11-01 23:59:59...
Writing file ./RESULTS/DAILY/081101/CHIRP/ScaleFactor_data_WSM_SS1_VV_2008-11-01.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/081101/CHIRP/ScaleFactor_ANX_WSM_SS1_VV.png...
Writing file ../../RESULTS/DAILY/081101/CHIRP/ScaleFactor_DATE_WSM_SS1_VV.png...

CHIRP ANALYSIS completed
#####

RAW DATA ANALYSIS

Analysis will be performed from 2008-11-01 00:00:00 to 2008-11-01 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/081101/RAW_DATA

Creating directory ./RESULTS/DAILY/081101/RAW_DATA...

Getting raw data for WVS from 2008-11-01 00:00:00 to 2008-11-01 23:59:59...
Writing file ./RESULTS/DAILY/081101/RAW_DATA/Raw_data_WVS_2008-11-01.dat...
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/081101/RAW_DATA/Raw_data_WVS_input_mean.png...
Creating image ../../RESULTS/DAILY/081101/RAW_DATA/Raw_data_WVS_input_stdev.png...
Creating image ../../RESULTS/DAILY/081101/RAW_DATA/Raw_data_WVS_gain_imbalance.png...

Getting raw data for IMM from 2008-11-01 00:00:00 to 2008-11-01 23:59:59...
Writing file ./RESULTS/DAILY/081101/RAW_DATA/Raw_data_IMM_2008-11-01.dat...

Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/081101/RAW_DATA/Raw_data_IMM_input_mean.png...
Creating image ../../RESULTS/DAILY/081101/RAW_DATA/Raw_data_IMM_input_stdev.png...
Creating image ../../RESULTS/DAILY/081101/RAW_DATA/Raw_data_IMM_gain_imbalance.png...

RAW DATA ANALYSIS completed

#####

TELEMETRY ANALYSIS

#####

Analysis will be performed from 2008-11-01 00:00:00 to 2008-11-01 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/081101/TELEMETRY

Creating directory ./RESULTS/DAILY/081101/TELEMETRY...

Looking for gaps and missing lines in WVS products...

Checking 19 products from PDE...
Checking 27 products from PDK...

Looking for gaps and missing lines in GM1 products...

Checking 25 products from PDE...
Checking 50 products from PDK...

Looking for gaps and missing lines in APM products...

Checking 2 products from PDE...
Checking 1 products from PDK...

Looking for gaps and missing lines in IMM products...

Checking 26 products from PDE...
Checking 4 products from PDK...

Looking for gaps and missing lines in WSM products...

Checking 45 products from PDE...
Found product...ASA_WSM_1PNPDE20081101_153620_00000612073_00269_34892_7817.N1 / 3 gaps / 1015 missing lines
Found product...ASA_WSM_1PNPDE20081101_184443_00000912073_00271_34894_7955.N1 / 0 gaps / 32 missing lines
No products from PDK...

Creating graph of missing lines and gaps...

Creating image: ./RESULTS/DAILY/081101/TELEMETRY/TELEMETRY_Missing_lines.png...
Creating image: ./RESULTS/DAILY/081101/TELEMETRY/TELEMETRY_Gaps.png...

TELEMETRY ANALYSIS completed

#####

BROWSE PRODUCTS ANALYSIS

#####

Analysis will be performed on 2008-11-01

Scanning directory /nas3/ENVISAT/ASAR//ASA_GM__BP...
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_GM__BP/JPG/20081101/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM__BP/ASA_GM__BPZPDE20081101_223149_000002112073_00273_34896_8046.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM__BP/ASA_GM__BPZPDE20081101_230818_000001502073_00273_34896_8048.N1 ...



Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081101_231323_000000902073_00273_34896_8050.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDE20081101_232308_000002472073_00273_34896_8061.N1 ...

ANALYSIS COMPLETED: 4 GM browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_AP_BP...
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_AP_BP/JPG/20081101/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_AP_BP/ASA_AP_BPZPDE20081101_201512_000000602073_00271_34894_7932.N1 ...

ANALYSIS COMPLETED: 1 AP browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_IM_BP...
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_IM_BP/JPG/20081101/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_110339_000000962073_00266_34889_7708.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_114503_000000482073_00266_34889_7785.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_143127_000000772073_00268_34891_7842.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_151745_000000522073_00268_34891_7836.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_152640_000001832073_00269_34892_7876.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_152640_000003762073_00269_34892_7878.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_153042_000000602073_00269_34892_7866.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_153244_000000132073_00269_34892_7870.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_171015_000000382073_00270_34893_7856.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_172927_000000392073_00270_34893_7880.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_173932_000002022073_00270_34893_7920.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_185246_000000672073_00271_34894_7926.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_195237_000001792073_00271_34894_7952.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_195614_000001222073_00271_34894_7958.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_195614_000003532073_00271_34894_7960.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_195917_000000592073_00271_34894_7946.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_200117_000000502073_00271_34894_7950.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_231050_000001412073_00273_34896_8143.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20081101_231450_000004882073_00273_34896_8163.N1 ...

ANALYSIS COMPLETED: 19 IM browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_WS_BP...
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_WS_BP/JPG/20081101/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_091432_000000912073_00265_34888_7591.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_092510_000001532073_00265_34888_7656.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_094315_000003732073_00265_34888_7779.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_094315_000005082073_00265_34888_7798.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_095113_000001152073_00265_34888_7680.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_095125_000000182073_00265_34888_7767.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_095336_000001472073_00265_34888_7749.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_112551_000002082073_00266_34889_7773.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_113313_000003912073_00266_34889_7816.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_115531_000002072073_00266_34889_7814.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_121807_000001092073_00267_34890_7777.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_124938_000000922073_00267_34890_7788.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_144503_000000912073_00268_34891_7872.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_153620_000000612073_00269_34892_7818.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_163600_000003302073_00269_34892_7874.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_173019_000002502073_00270_34893_7922.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_181931_000001652073_00270_34893_7918.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_184443_000000912073_00271_34894_7956.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_184550_000000732073_00271_34894_7904.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_184550_000001532073_00271_34894_7954.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_184805_000000182073_00271_34894_7908.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_190634_000000922073_00271_34894_7924.N1 ...



Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20081101_235904_00002262073_00274_34897_8324.N1 ...

ANALYSIS COMPLETED: 23 WS browse products to see...

BROWSE PRODUCTS ANALYSIS completed

#####

HTML REPORT generation

#####

Building file ./RESULTS/DAILY/081101/asarReport.html...

Building DATA SUMMARY section...

Building AUXILIARY FILES ANALYSIS section...

Building MODULE STEPPING ANALYSIS section...

Building CALIBRATION PULSES ANALYSIS section...

Building DOPPLER ANALYSIS section...

Building CHIRP ANALYSIS section...

Building RAW DATA ANALYSIS section...

Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed

#####



ASAR Daily Report



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20081101_074303_000001822073_00264_34887_7539.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20081101_201512_000000602073_00271_34894_7931.N1	OK	OK	OK	OK
ASA_APM_1PNPDK20081101_134800_000000432073_00268_34891_9913.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20081101_003537_000000722073_00260_34883_6827.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_004246_000003682073_00260_34883_6829.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_005010_000000962073_00260_34883_6831.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_010855_000003622073_00260_34883_6836.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_012031_000004282073_00260_34883_6846.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_013410_000003202073_00260_34883_6844.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_014642_000006342073_00260_34883_6982.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_020124_000007062073_00261_34884_6989.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_021837_000012262073_00261_34884_7053.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_030107_000000842073_00261_34884_7094.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_031245_000004412073_00261_34884_7106.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_032138_000002592073_00261_34884_7104.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_032600_000001022073_00261_34884_7099.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_033058_000003022073_00261_34884_7113.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_033822_000001262073_00262_34885_7108.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_034947_000014022073_00262_34885_7196.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_041937_000001322073_00262_34885_7143.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_044143_000004592073_00262_34885_7354.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_052313_000005922073_00263_34886_7352.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_053444_000007732073_00263_34886_7356.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_054824_000007972073_00263_34886_7390.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_223149_000002112073_00273_34896_8045.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_230818_000001502073_00273_34896_8047.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_231323_000000902073_00273_34896_8049.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20081101_232308_000002472073_00273_34896_8060.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_062636_000001442073_00263_34886_9284.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_063557_000003202073_00263_34886_9294.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_071541_000005552073_00264_34887_9319.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_072347_000005862073_00264_34887_9389.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_073824_000002772073_00264_34887_9391.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_074626_000001572073_00264_34887_9393.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_075339_000000842073_00264_34887_9395.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_080513_000010032073_00264_34887_9481.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_085534_000006222073_00265_34888_9404.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_090449_000001202073_00265_34888_9534.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_092326_000001022073_00265_34888_9536.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_095610_000003802073_00265_34888_9541.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_103349_000007372073_00266_34889_9551.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_104452_000001142073_00266_34889_9672.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_110051_000001692073_00266_34889_9677.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_112407_000001022073_00266_34889_9679.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_112925_000002232073_00266_34889_9681.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_113947_000001992073_00266_34889_9689.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_121224_000003382073_00267_34890_9694.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_122000_000001992073_00267_34890_9701.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_125112_000004412073_00267_34890_9812.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_125835_000001082073_00267_34890_9814.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_130442_000007182073_00267_34890_9819.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_131929_000002532073_00267_34890_9824.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_132803_000004652073_00267_34890_9834.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_135046_000001202073_00268_34891_9832.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_135332_000006702073_00268_34891_9844.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_140332_000001322073_00268_34891_9963.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_141103_000002772073_00268_34891_9965.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_141806_000008032073_00268_34891_9967.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_143255_000000902073_00268_34891_9972.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_144637_000010622073_00268_34891_0065.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_152243_000002352073_00269_34892_9986.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_153310_000000962073_00269_34892_9984.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_153725_000002412073_00269_34892_9996.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_154914_000001442073_00269_34892_0101.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_155418_000007122073_00269_34892_0103.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_162554_000006042073_00269_34892_0105.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_164134_000001992073_00269_34892_0110.N1					OK	OK	OK	OK

ASA_GM1_1PNPDK20081101_170232_000004652073_00270_34893_0112.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_171105_000004222073_00270_34893_0119.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_172736_000001142073_00270_34893_0288.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_173442_000002892073_00270_34893_0290.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_180630_000007792073_00270_34893_0292.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_182221_000000902073_00270_34893_0297.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_184827_000002592073_00271_34894_0299.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_185404_000002292073_00271_34894_0309.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_190811_000004832073_00271_34894_0432.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_194706_000003322073_00271_34894_0434.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20081101_200216_000002292073_00271_34894_0447.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_IMM_1PNPDE20081101_003117_000002432073_00260_34883_6975.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_003117_000002502073_00260_34883_7251.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_003651_000000942073_00260_34883_6932.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_024127_000000372073_00261_34884_6963.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_041308_000003632073_00262_34885_7235.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_041308_000003782073_00262_34885_7249.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_045442_000001632073_00262_34885_7347.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_110339_000000962073_00266_34889_7707.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_114503_000000482073_00266_34889_7784.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_143127_000000772073_00268_34891_7841.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_151745_000000522073_00268_34891_7835.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_152640_000001832073_00269_34892_7875.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_152640_000003762073_00269_34892_7877.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_153042_000000602073_00269_34892_7865.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_153244_000000132073_00269_34892_7869.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_171015_000000382073_00270_34893_7855.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_172927_000000392073_00270_34893_7879.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_173932_000002022073_00270_34893_7919.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_185246_000000672073_00271_34894_7925.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_195237_000001792073_00271_34894_7951.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_195614_000001222073_00271_34894_7957.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_195614_000003532073_00271_34894_7959.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_195917_000000592073_00271_34894_7945.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_200117_000000502073_00271_34894_7949.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_231050_000001412073_00273_34896_8142.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20081101_231450_000004882073_00273_34896_8162.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20081101_054736_000000372073_00263_34886_0218.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20081101_071308_000001412073_00264_34887_9380.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20081101_135244_000000362073_00268_34891_9921.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20081101_140547_000003022073_00268_34891_9943.N1					OK	OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WSM_1PNPDE20081101_003904_000002142073_00260_34883_7452.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_004018_000001392073_00260_34883_6977.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_012743_000003732073_00260_34883_6969.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_021317_000001352073_00261_34884_7090.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_021317_000003122073_00261_34884_7472.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_021627_000001212073_00261_34884_7091.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_023907_000000912073_00261_34884_6984.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_024212_000000922073_00261_34884_7055.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_030450_000003482073_00261_34884_7146.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_031111_000000922073_00261_34884_7228.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_034034_000001532073_00262_34885_7233.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_034348_000001352073_00262_34885_7319.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_034348_000003542073_00262_34885_7474.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_034658_000001632073_00262_34885_7320.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_044926_000001352073_00262_34885_7464.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_044926_000002932073_00262_34885_7505.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_045337_000000422073_00262_34885_7345.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_045747_000001652073_00262_34885_7450.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_053310_000000732073_00263_34886_7329.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_062202_000002692073_00263_34886_7480.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_074908_000002502073_00264_34887_7553.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_075509_000001902073_00264_34887_7545.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_091432_000000912073_00265_34888_7590.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_092510_000001532073_00265_34888_7655.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_094315_000003732073_00265_34888_7778.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_094315_000005082073_00265_34888_7797.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_095113_000001152073_00265_34888_7679.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_095125_000000182073_00265_34888_7766.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_095336_000001472073_00265_34888_7748.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_112551_000002082073_00266_34889_7772.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_113313_000003912073_00266_34889_7815.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_115531_000002072073_00266_34889_7813.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_121807_000001092073_00267_34890_7776.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_124938_000000922073_00267_34890_7787.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_144503_000000912073_00268_34891_7871.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_153620_000000612073_00269_34892_7817.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_163600_000003302073_00269_34892_7873.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_173019_000002502073_00270_34893_7921.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_181931_000001652073_00270_34893_7917.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_184443_000000912073_00271_34894_7955.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_184550_000000732073_00271_34894_7903.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_184550_000001532073_00271_34894_7953.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_184805_000000182073_00271_34894_7907.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_190634_000000922073_00271_34894_7923.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20081101_235904_000002262073_00274_34897_8323.N1					OK	OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20081101_000258_000016492073_00259_34882_6834.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_005149_000009752073_00260_34883_6839.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_011502_000002852073_00260_34883_6849.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_013934_000001192073_00260_34883_6842.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_014034_000003302073_00260_34883_6980.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_015717_000002092073_00261_34884_6987.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_024343_000010042073_00261_34884_6992.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_030013_000000152073_00261_34884_7102.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_032010_000000452073_00261_34884_7097.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_032744_000001492073_00261_34884_7111.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_033603_000000892073_00262_34885_7134.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_042151_000008992073_00262_34885_7141.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_043621_000001352073_00262_34885_7350.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_050037_000013192073_00262_34885_7388.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_060141_000009742073_00263_34886_7393.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_223523_000019342073_00273_34896_8058.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_232721_000001652073_00273_34896_8063.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20081101_232921_000017392073_00273_34896_8189.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_061741_000002252073_00263_34886_9287.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_064122_000018742073_00263_34886_9322.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_075936_000001352073_00264_34887_9398.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_082158_000019792073_00264_34887_9407.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_092741_000008842073_00265_34888_9539.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_100233_000018292073_00265_34888_9544.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_105138_000000602073_00266_34889_9670.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_105814_000001192073_00266_34889_9675.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_110521_000010792073_00266_34889_9684.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_114309_000000752073_00266_34889_9687.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_114558_000005242073_00266_34889_9692.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_115901_000007642073_00267_34890_9704.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_123214_000009892073_00267_34890_9817.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_130027_000002102073_00267_34890_9822.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_132345_000002102073_00267_34890_9827.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_133549_000005242073_00267_34890_9830.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_134539_000000442073_00268_34891_9842.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_141544_000001052073_00268_34891_9970.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_143429_000005852073_00268_34891_9975.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_150421_000007642073_00268_34891_9978.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_151843_000001942073_00268_34891_9989.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_160614_000011392073_00269_34892_0108.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_164457_000010042073_00269_34892_0122.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_174301_000013642073_00270_34893_0295.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_182822_000009442073_00270_34893_0307.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_191616_000017992073_00271_34894_0437.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20081101_200609_000004502073_00271_34894_0445.N1					OK	OK	OK	OK


Calibration pulses for GM1 SS3 H/H

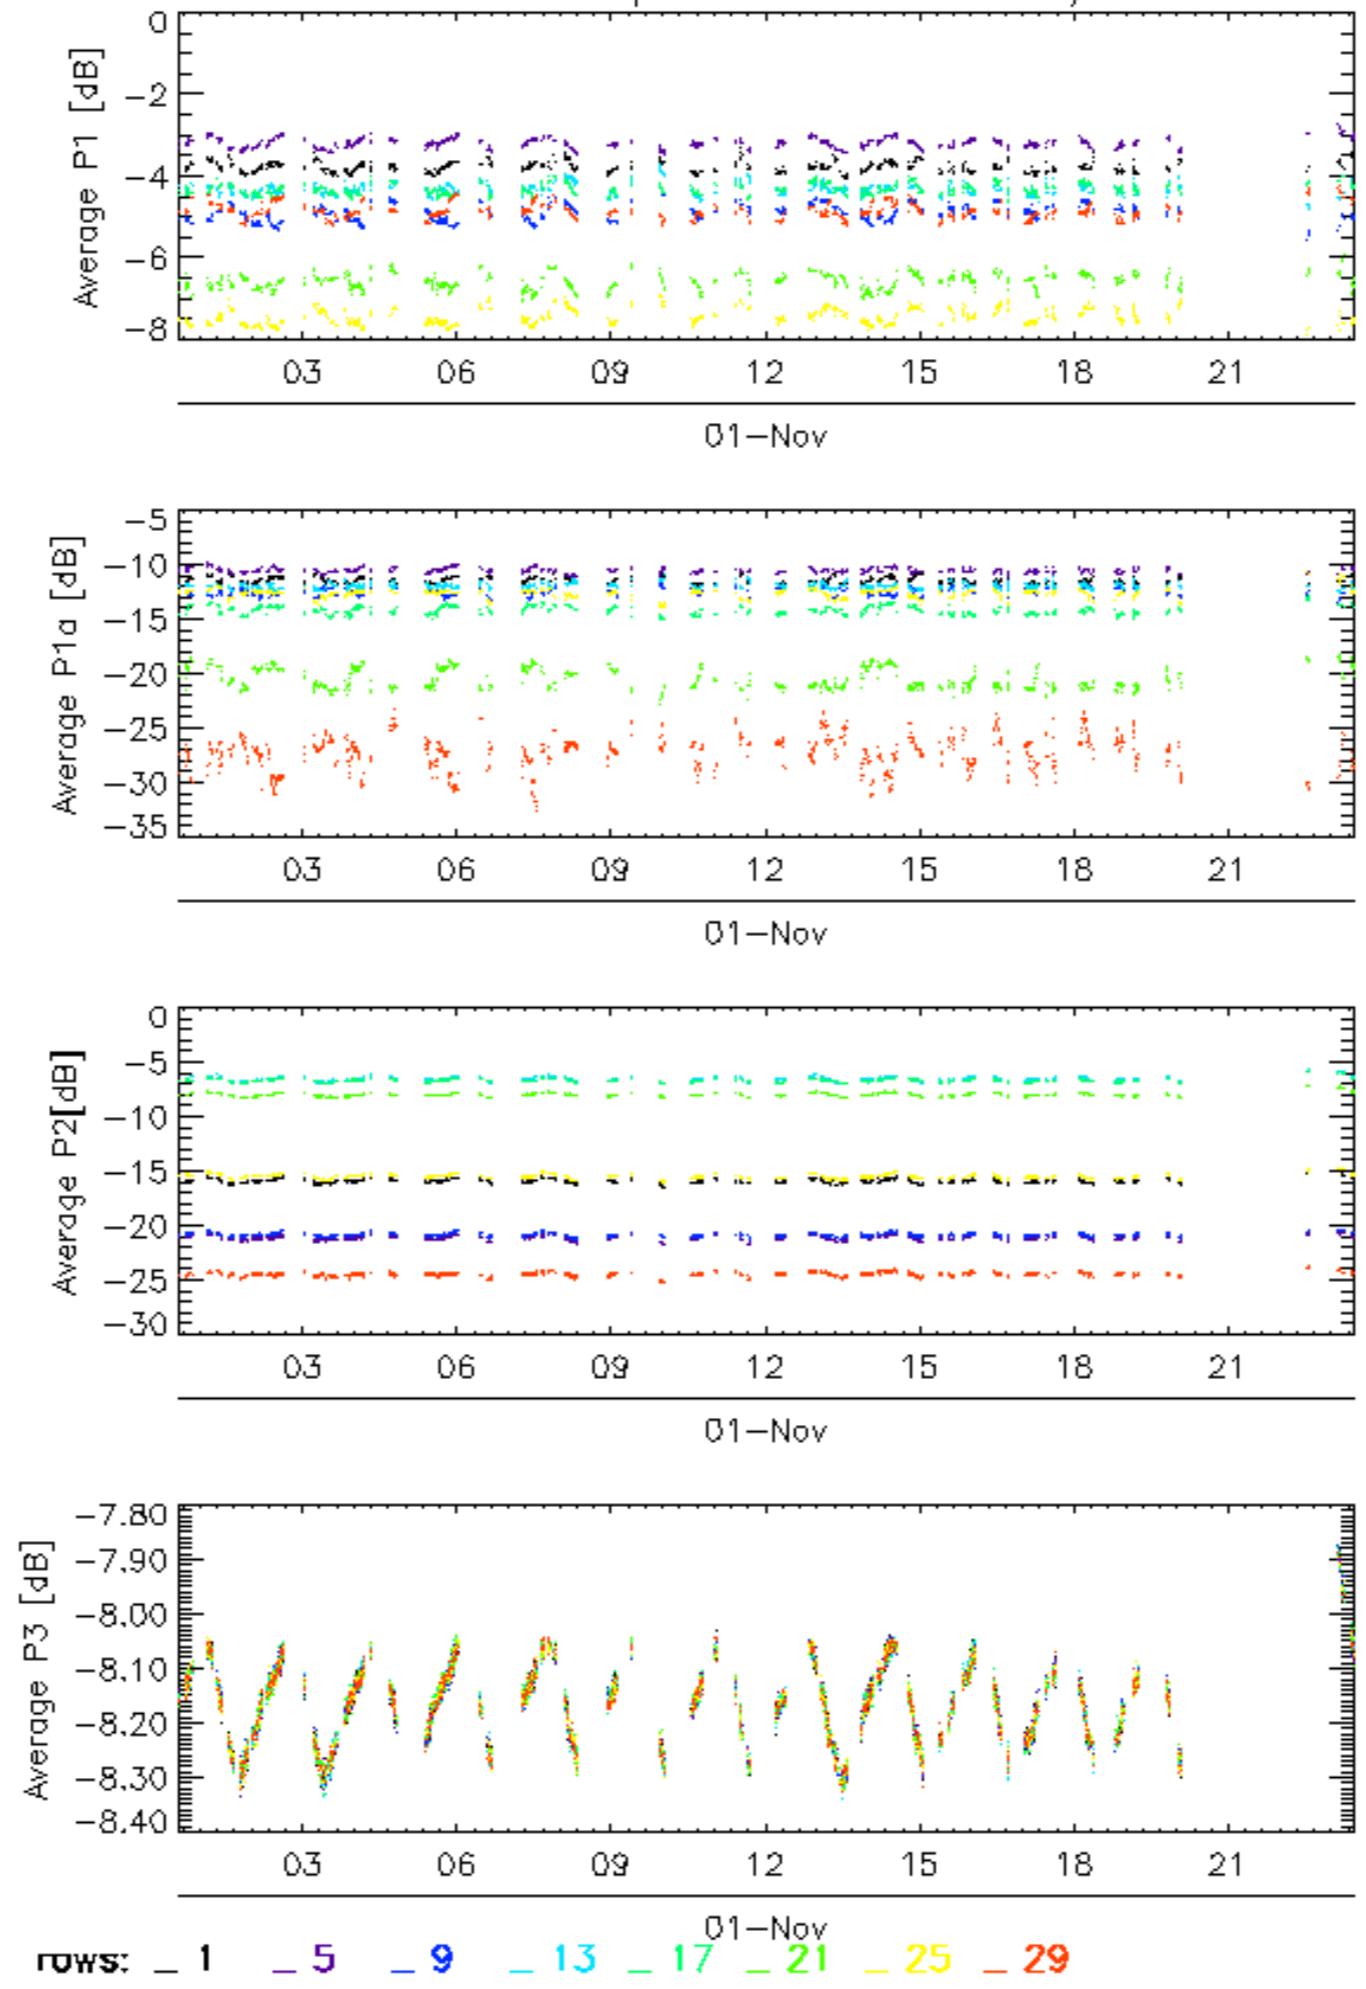


Calibration pulses for GM1 SS3 H/H

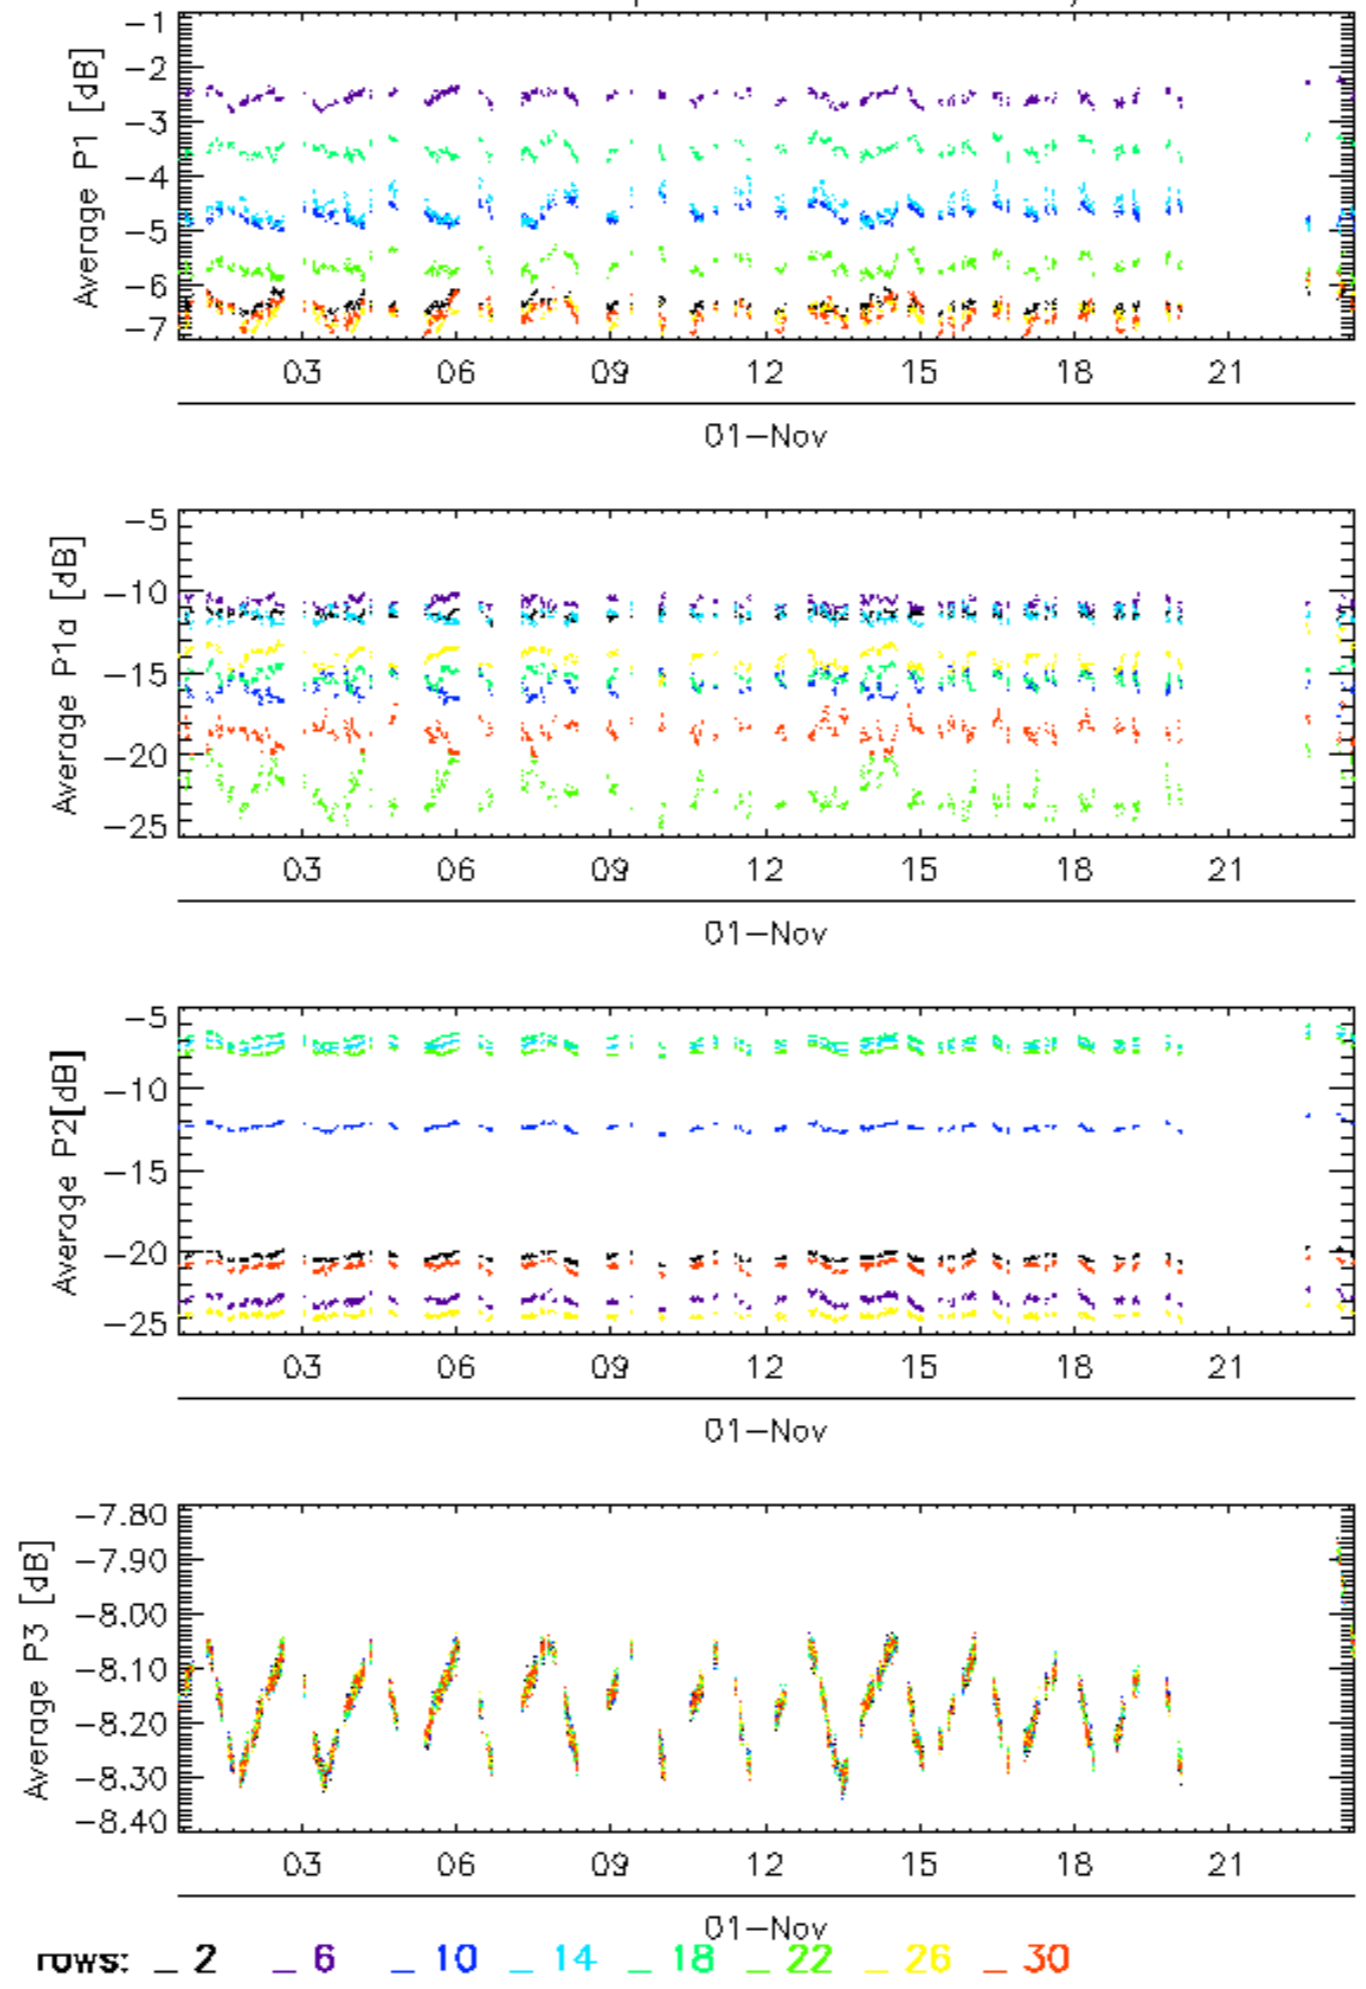


Calibration pulses for GM1 SS3 H/H

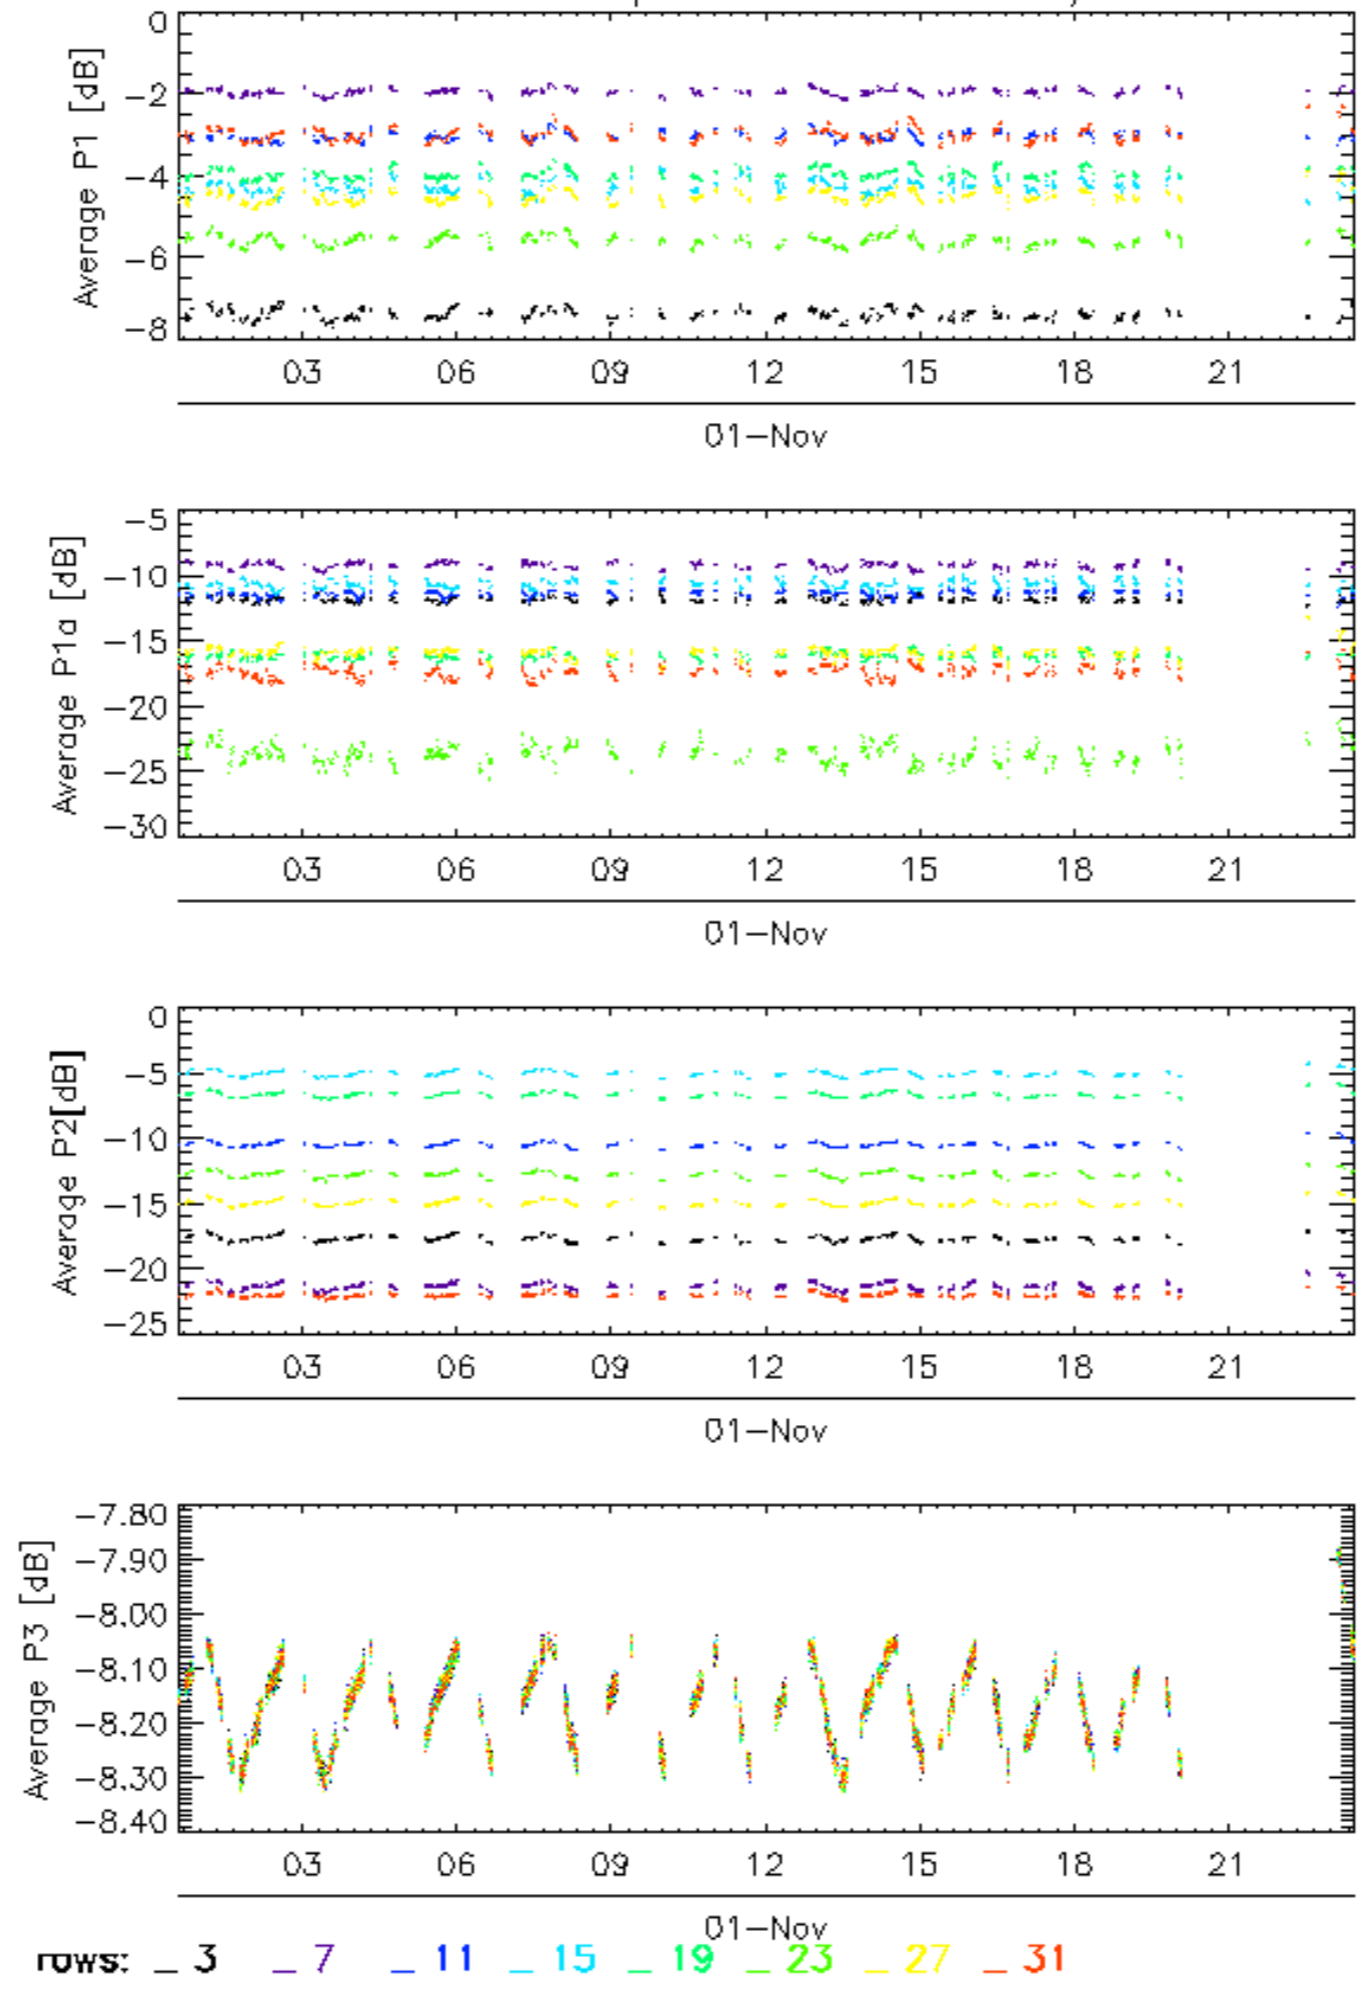


Calibration pulses for GM1 SS3 H/H

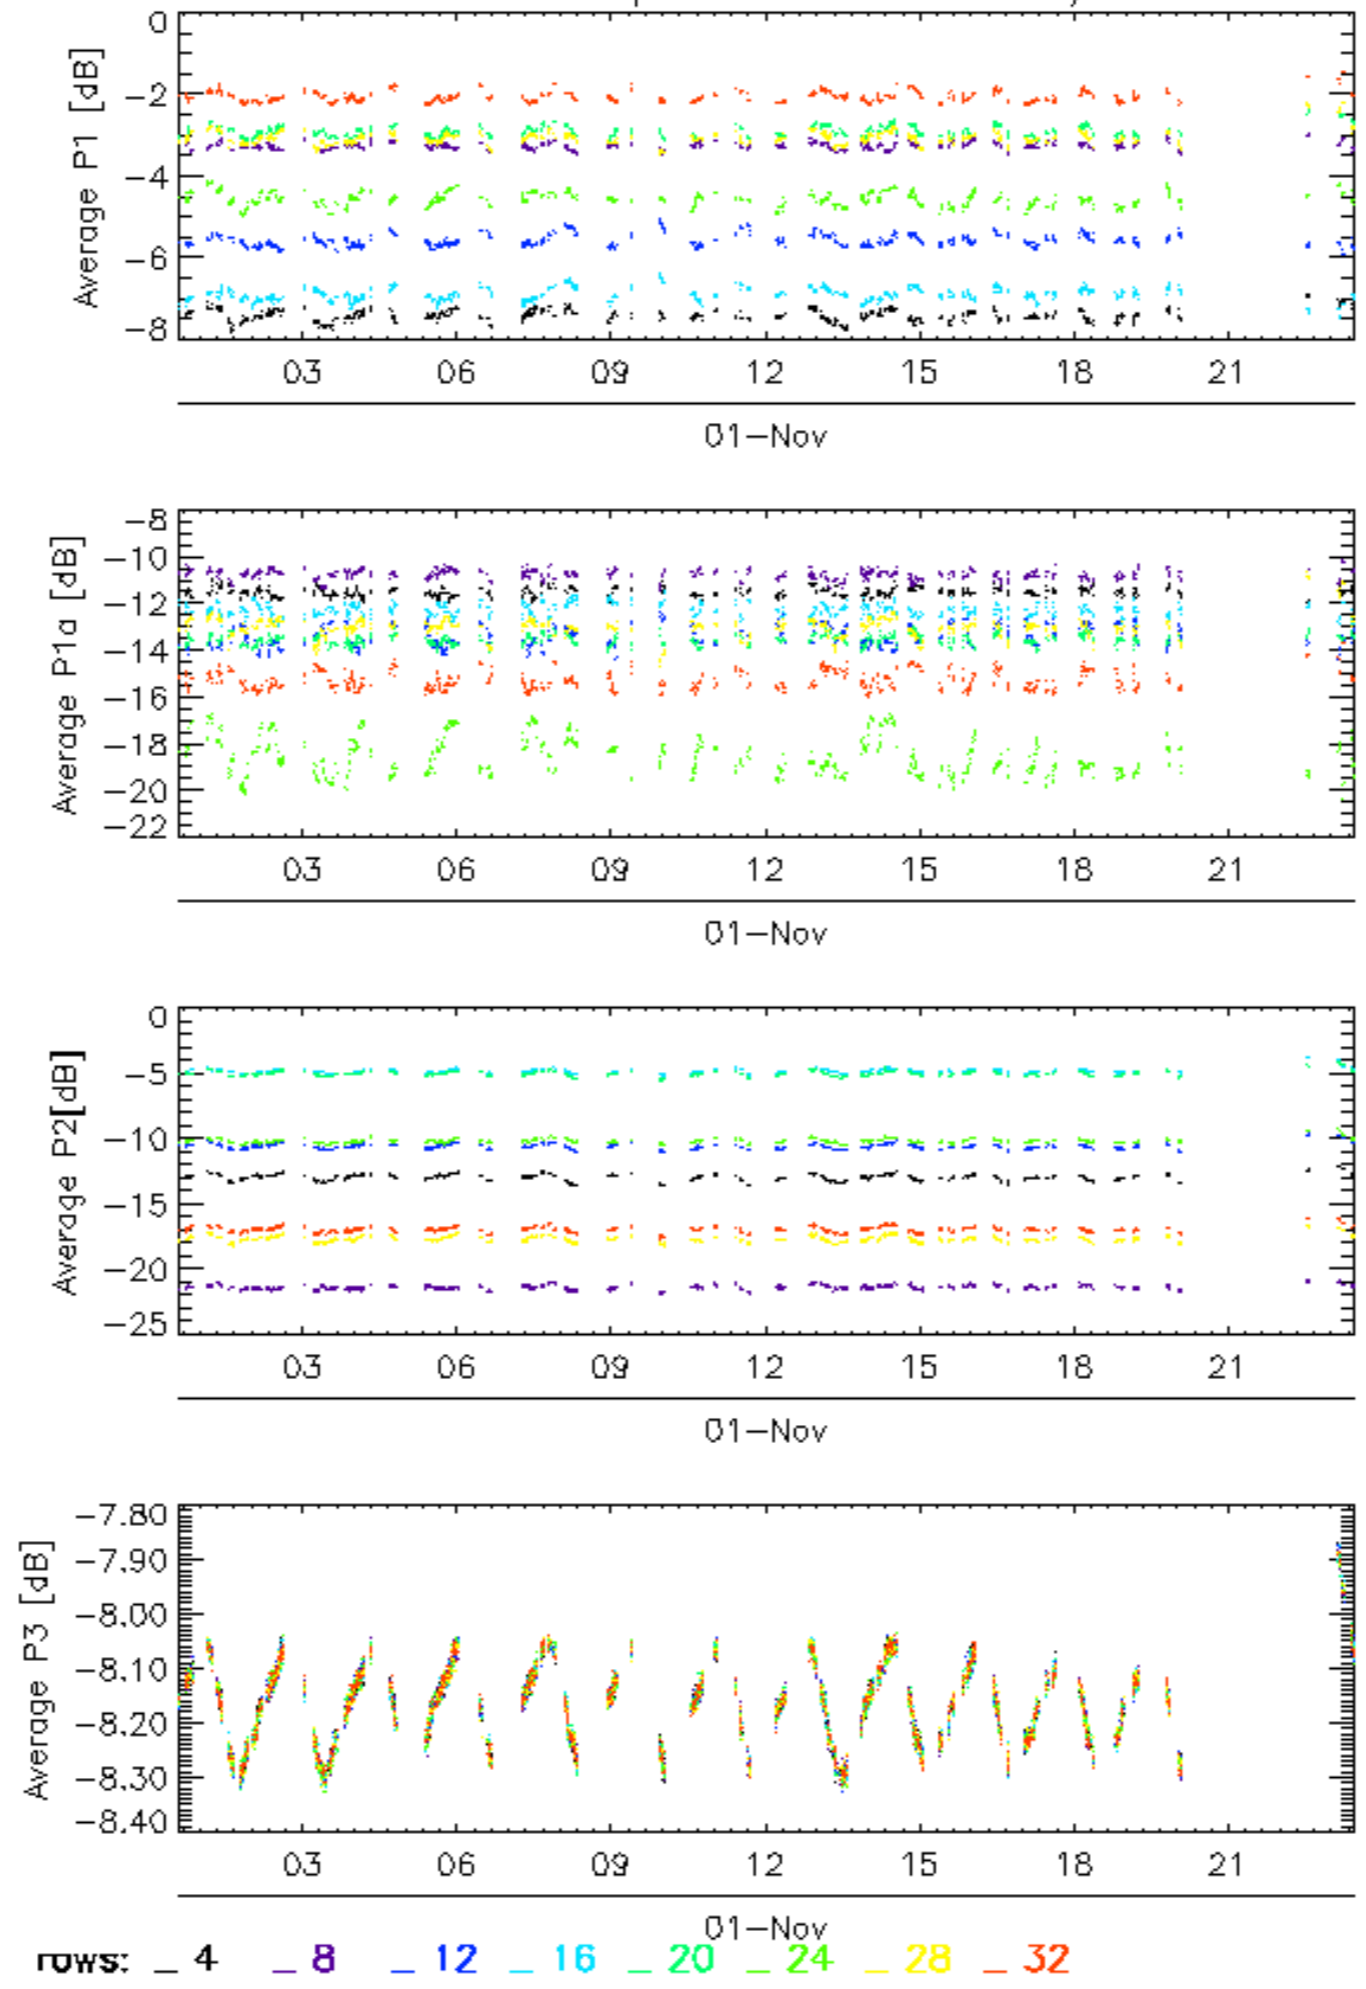


Calibration pulses for WVS IS2 V/V

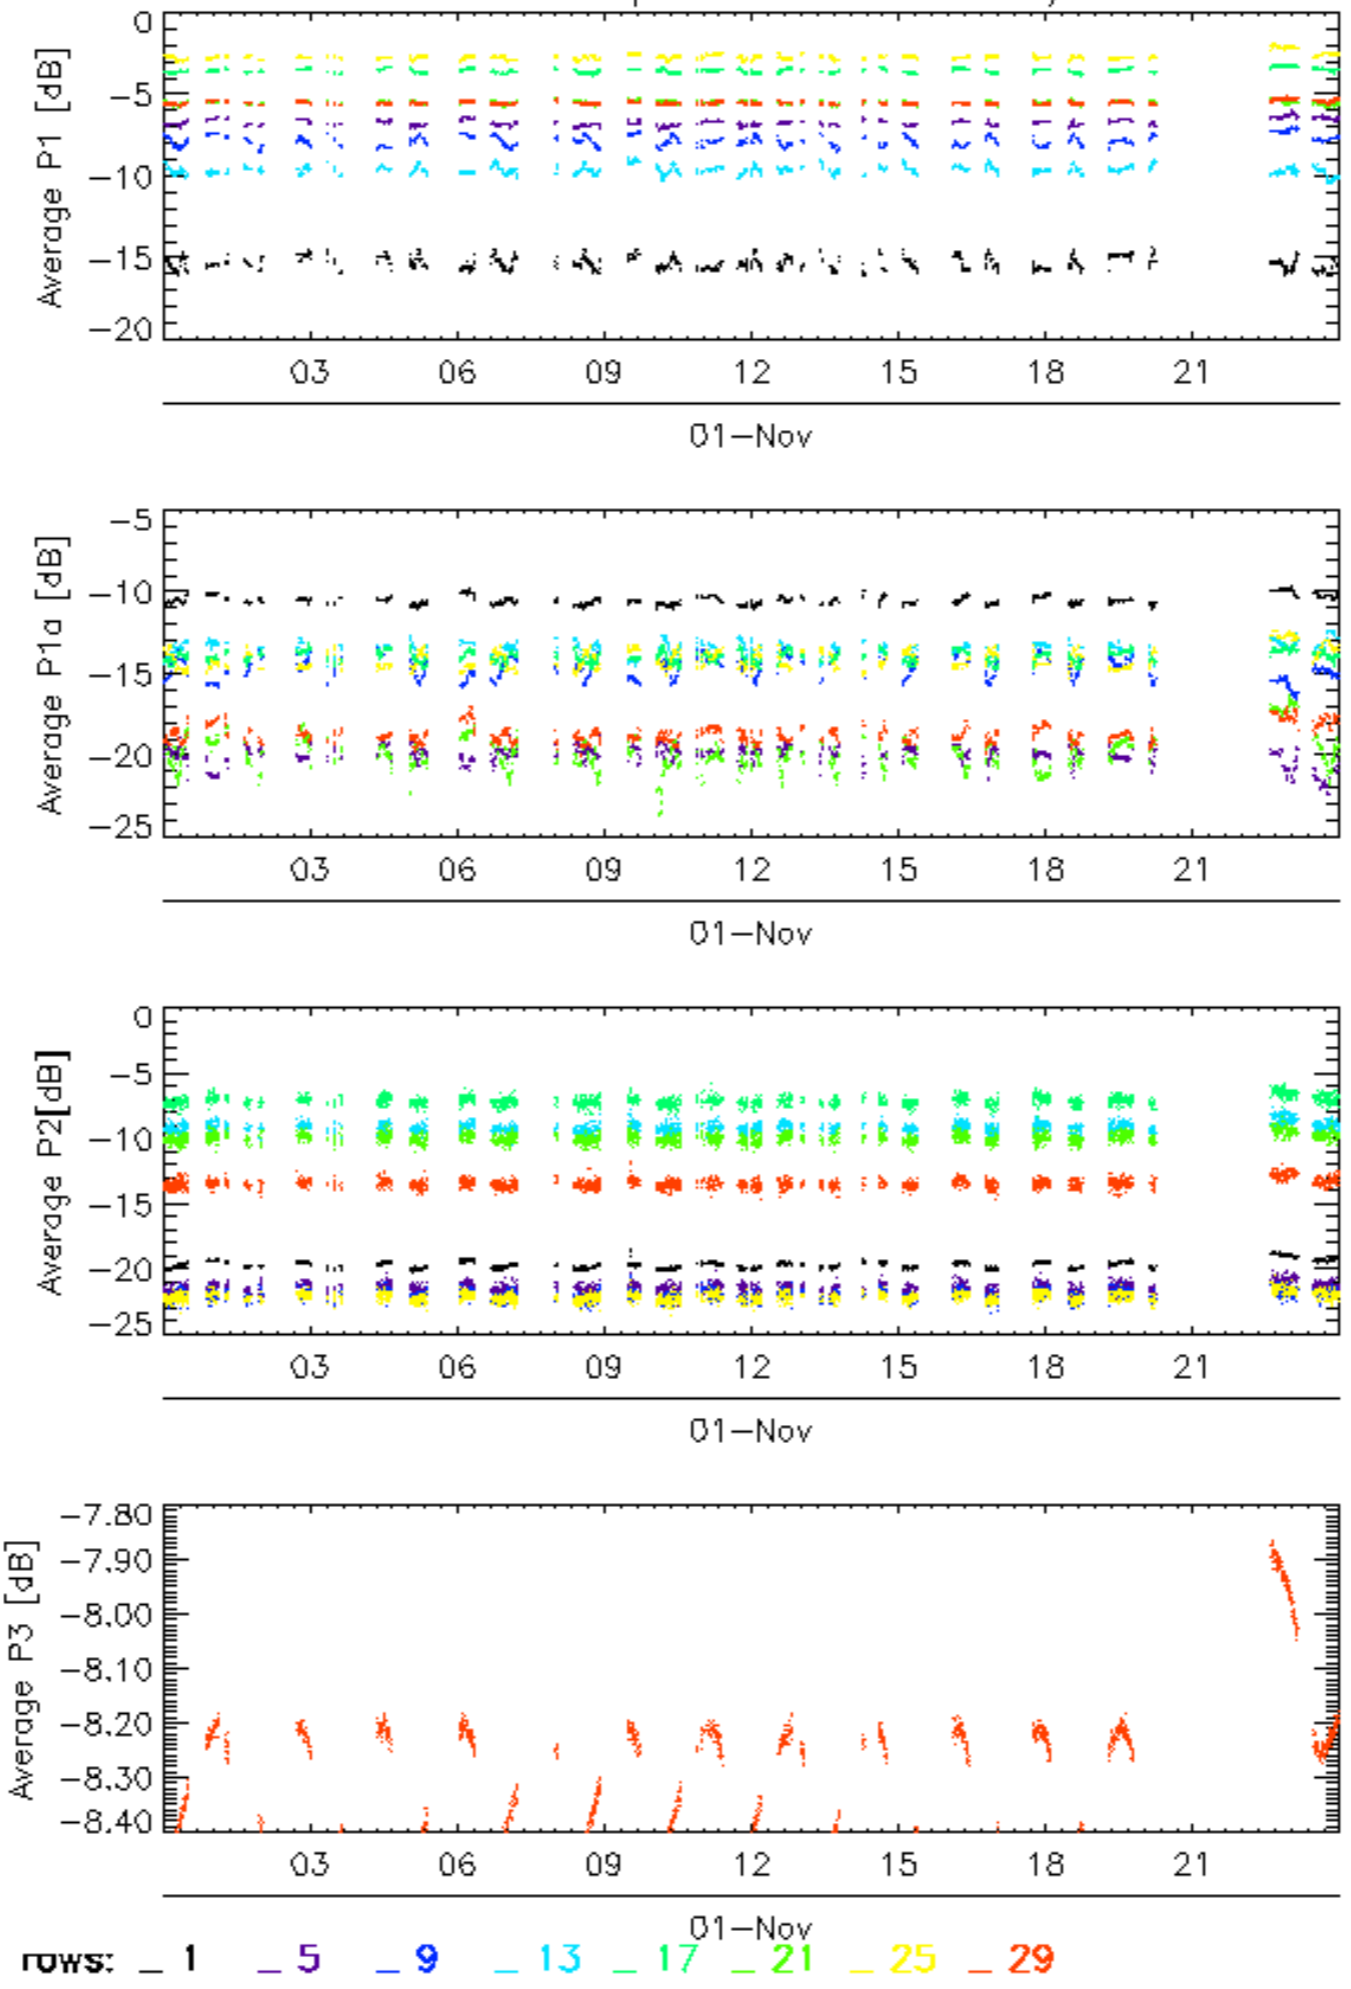


Calibration pulses for WVS IS2 V/V

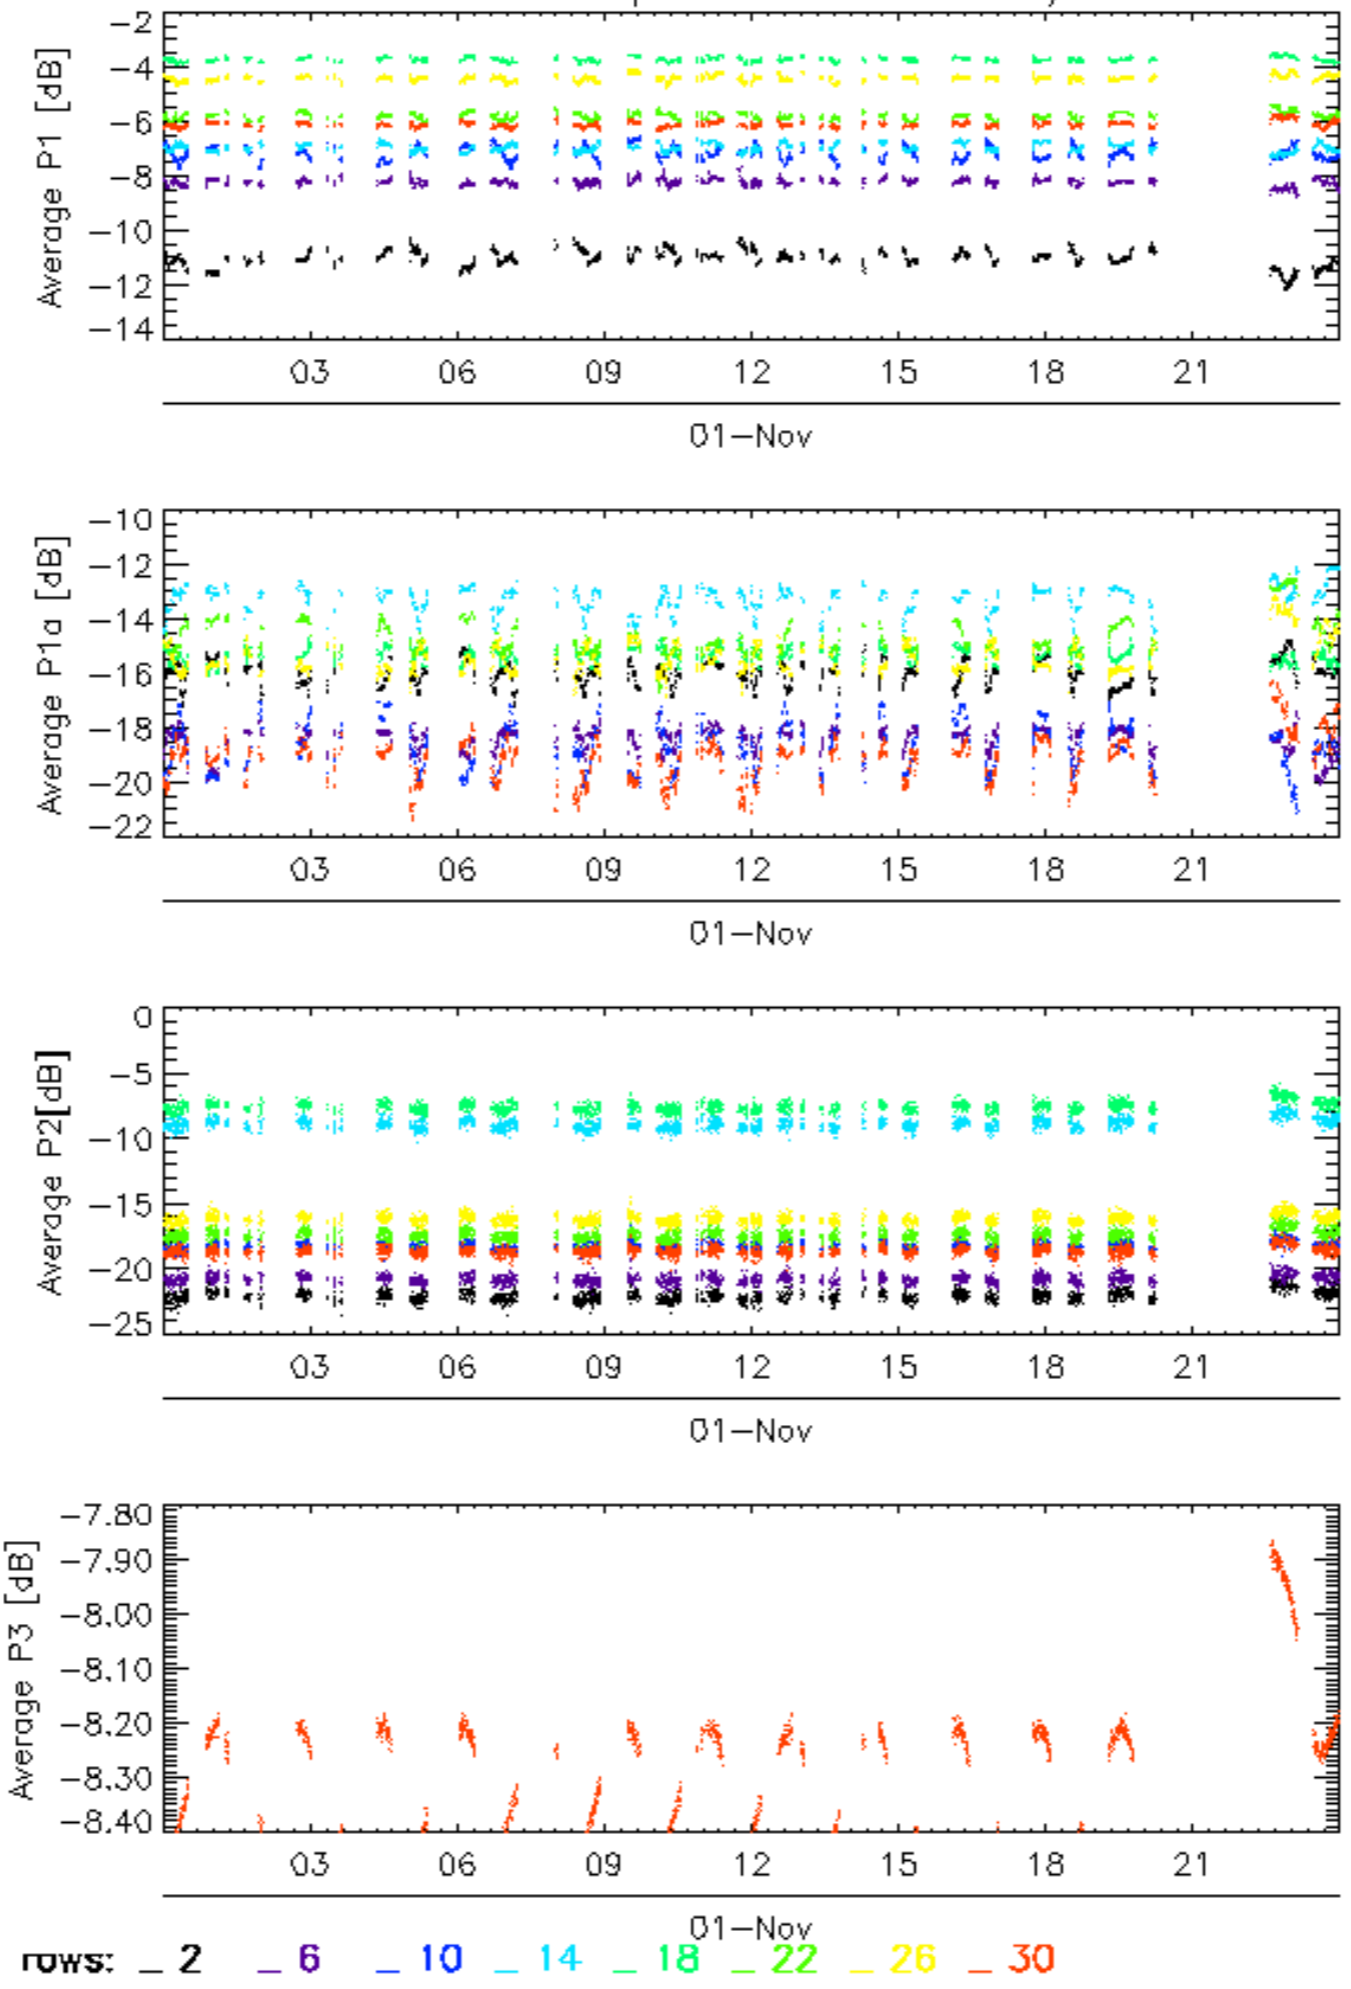



Calibration pulses for WVS IS2 V/V


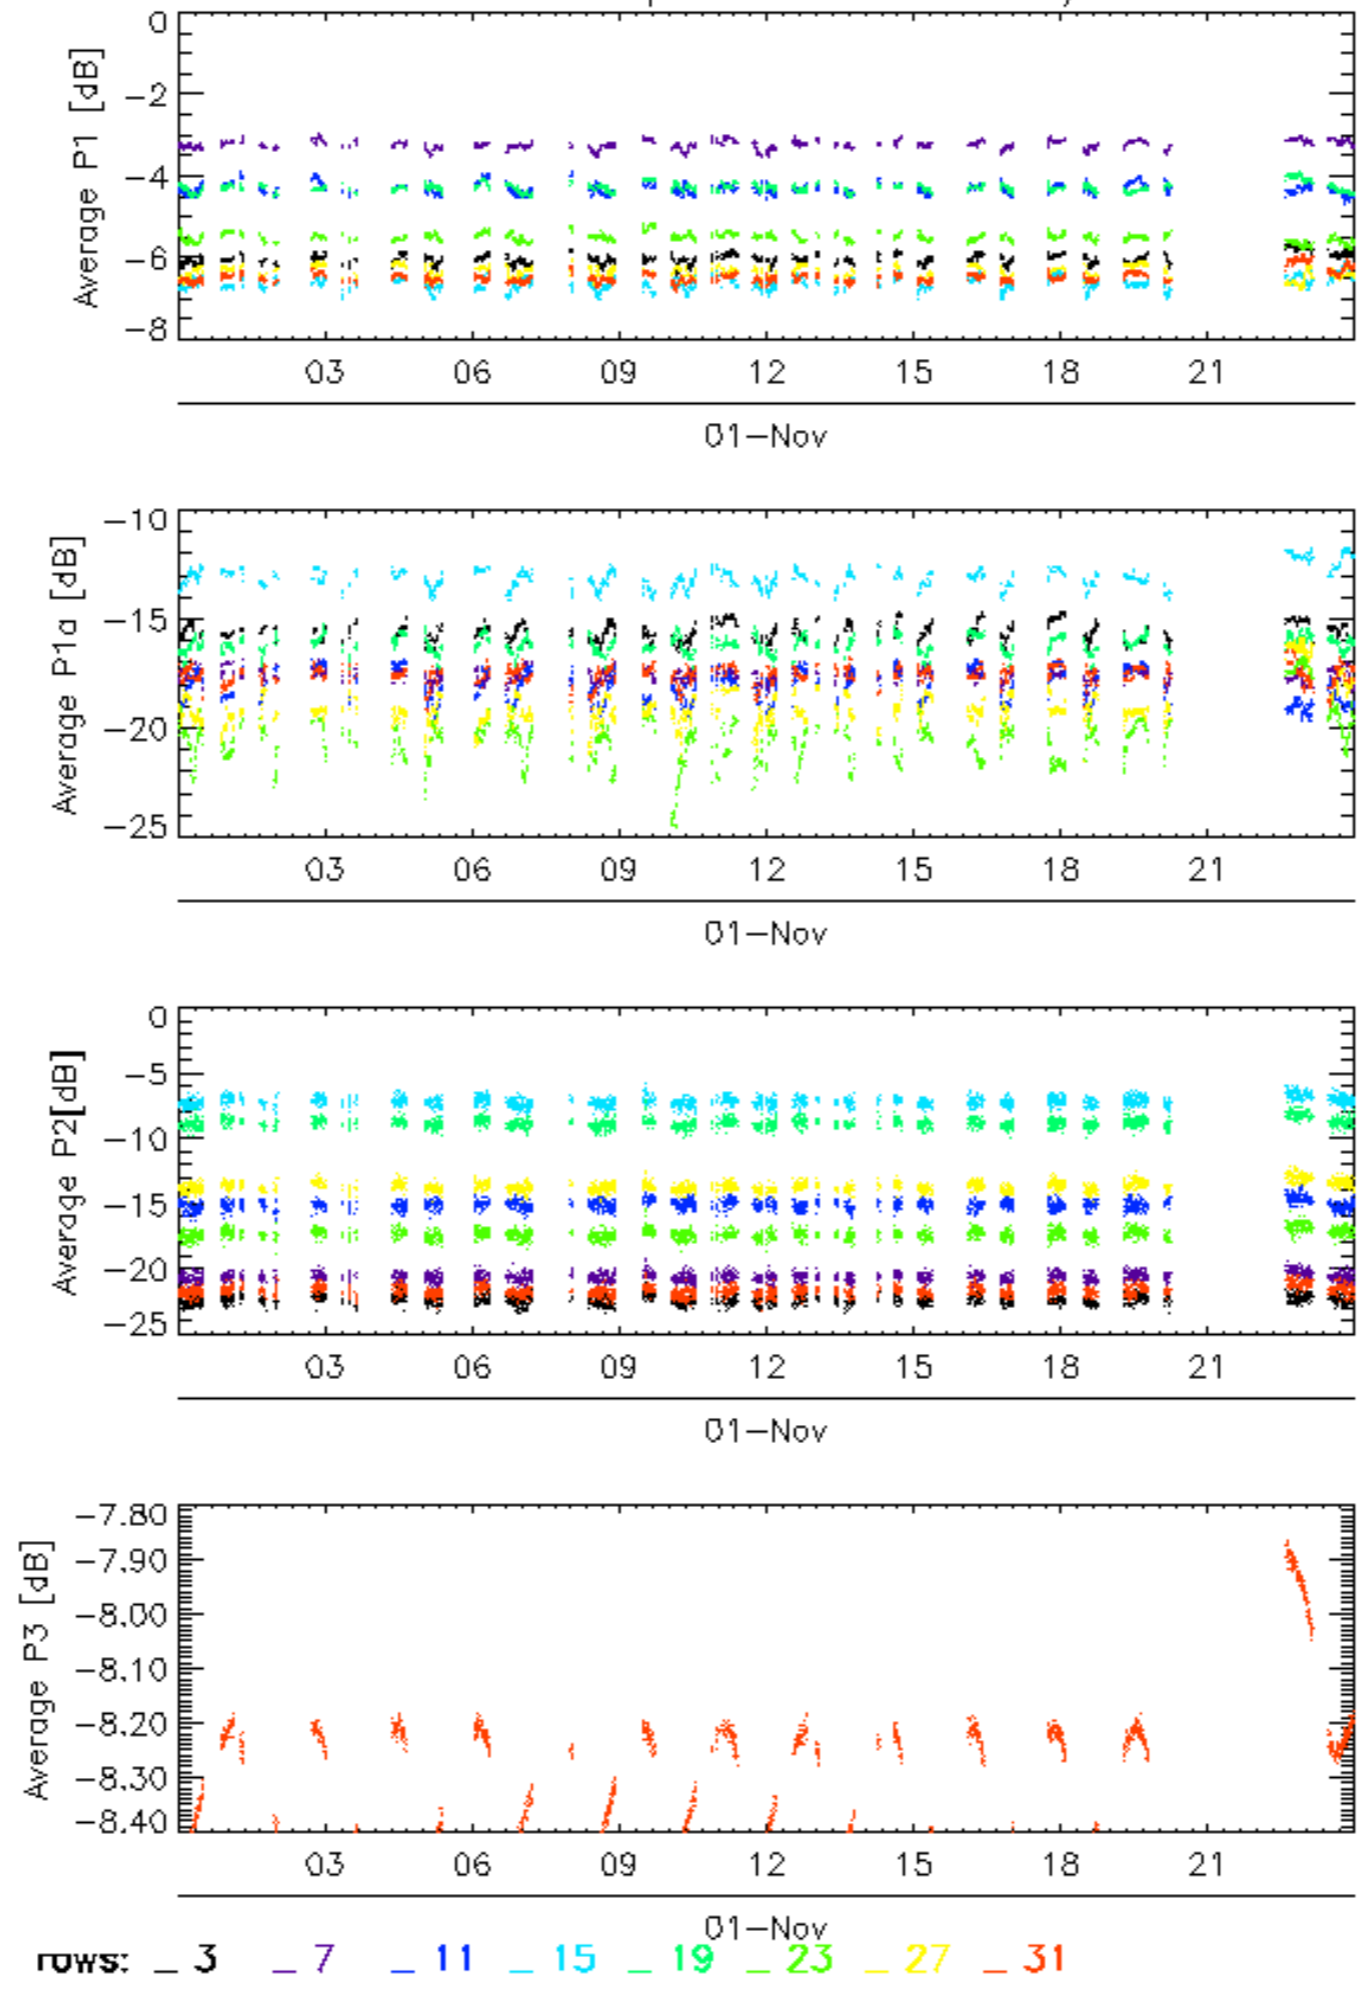




Calibration pulses for WVS IS2 V/V


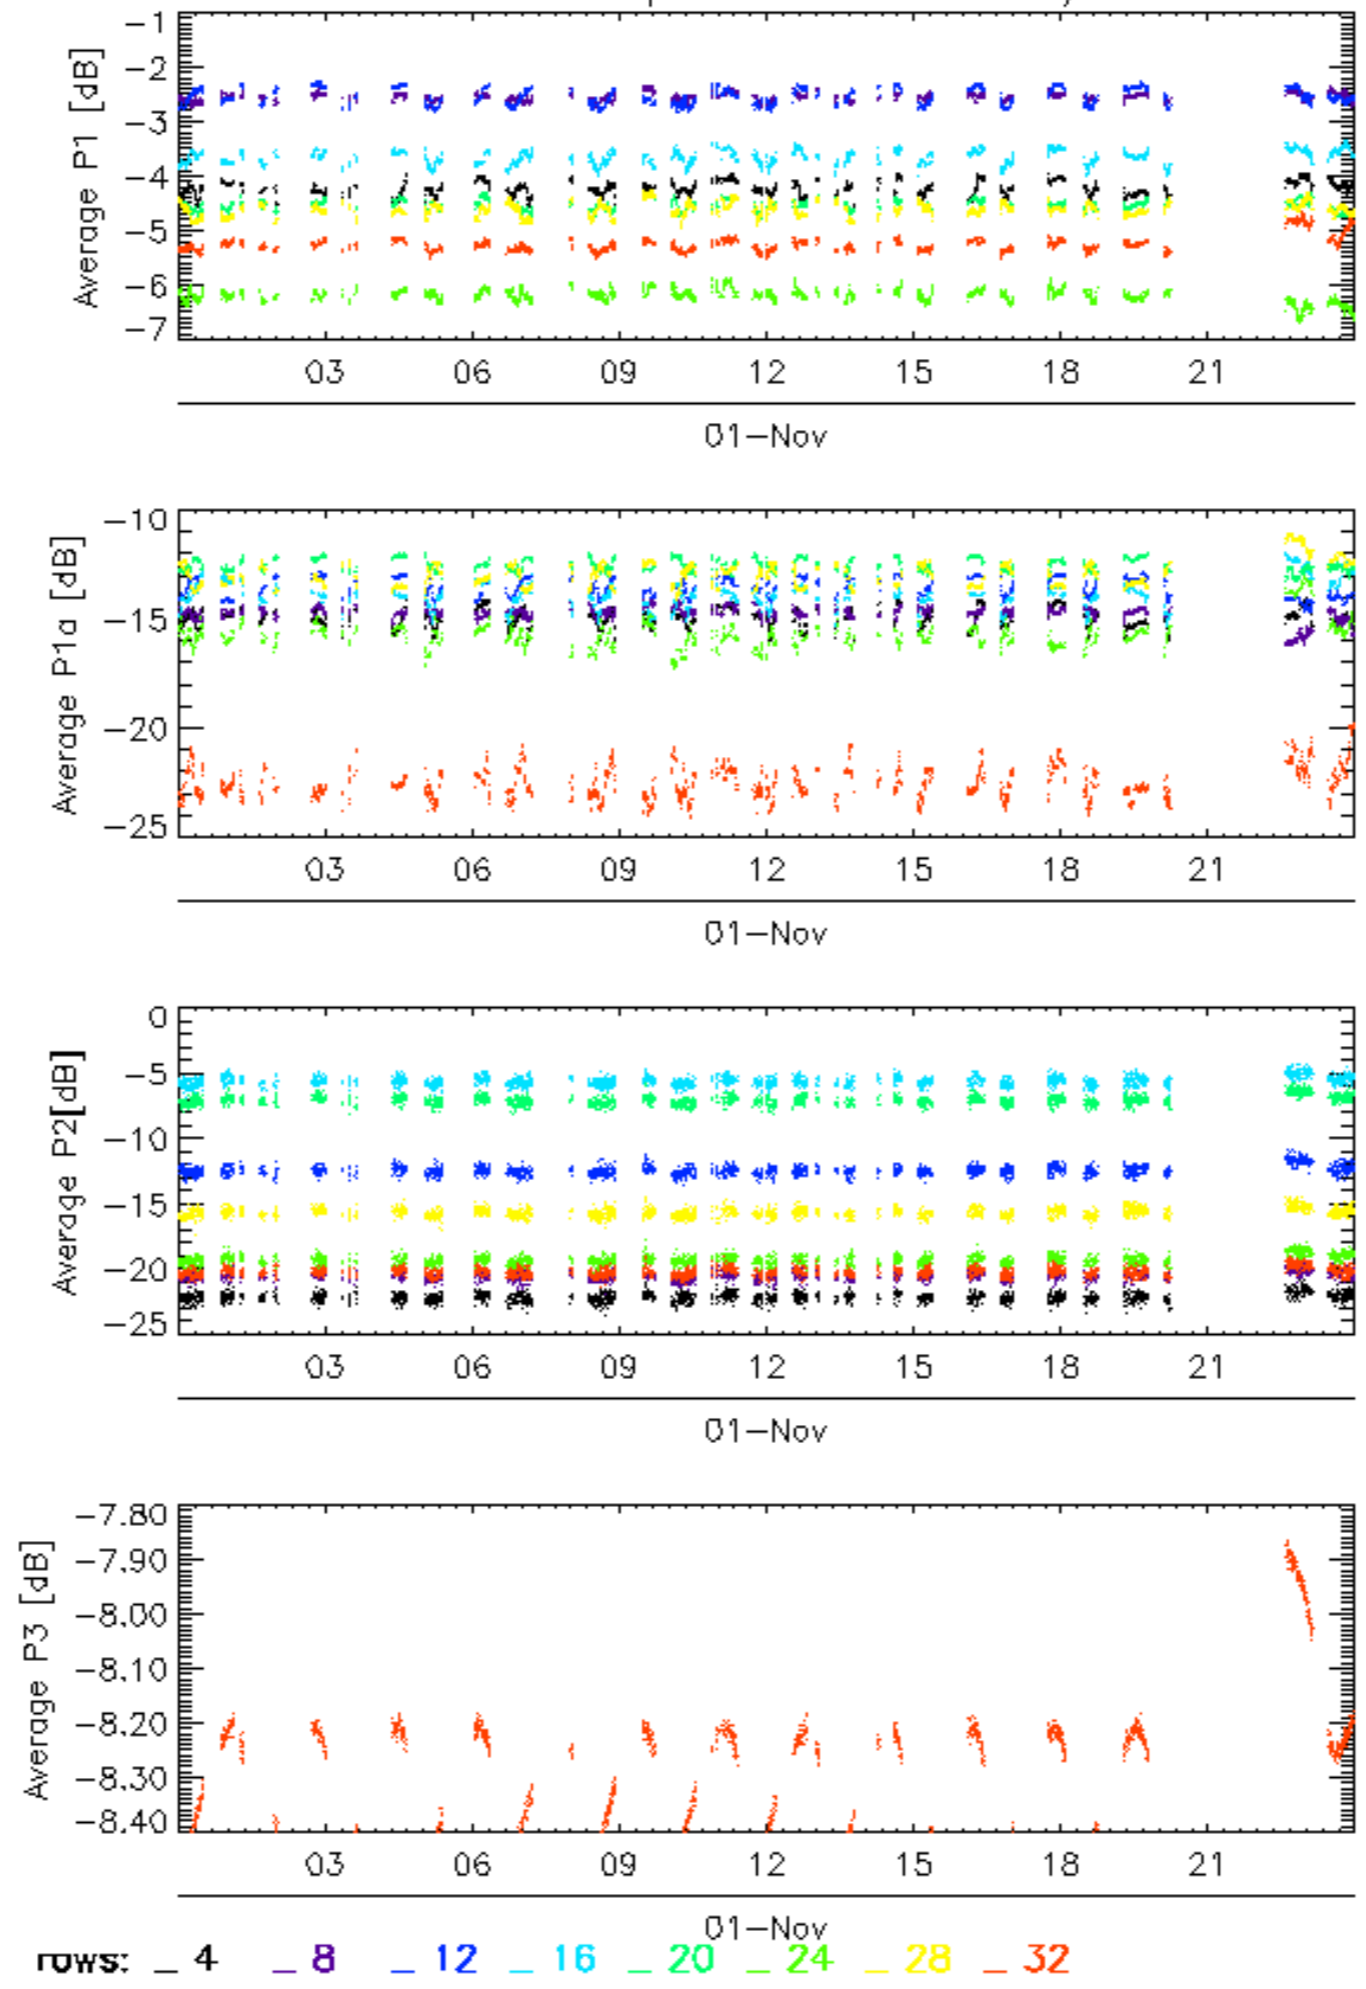



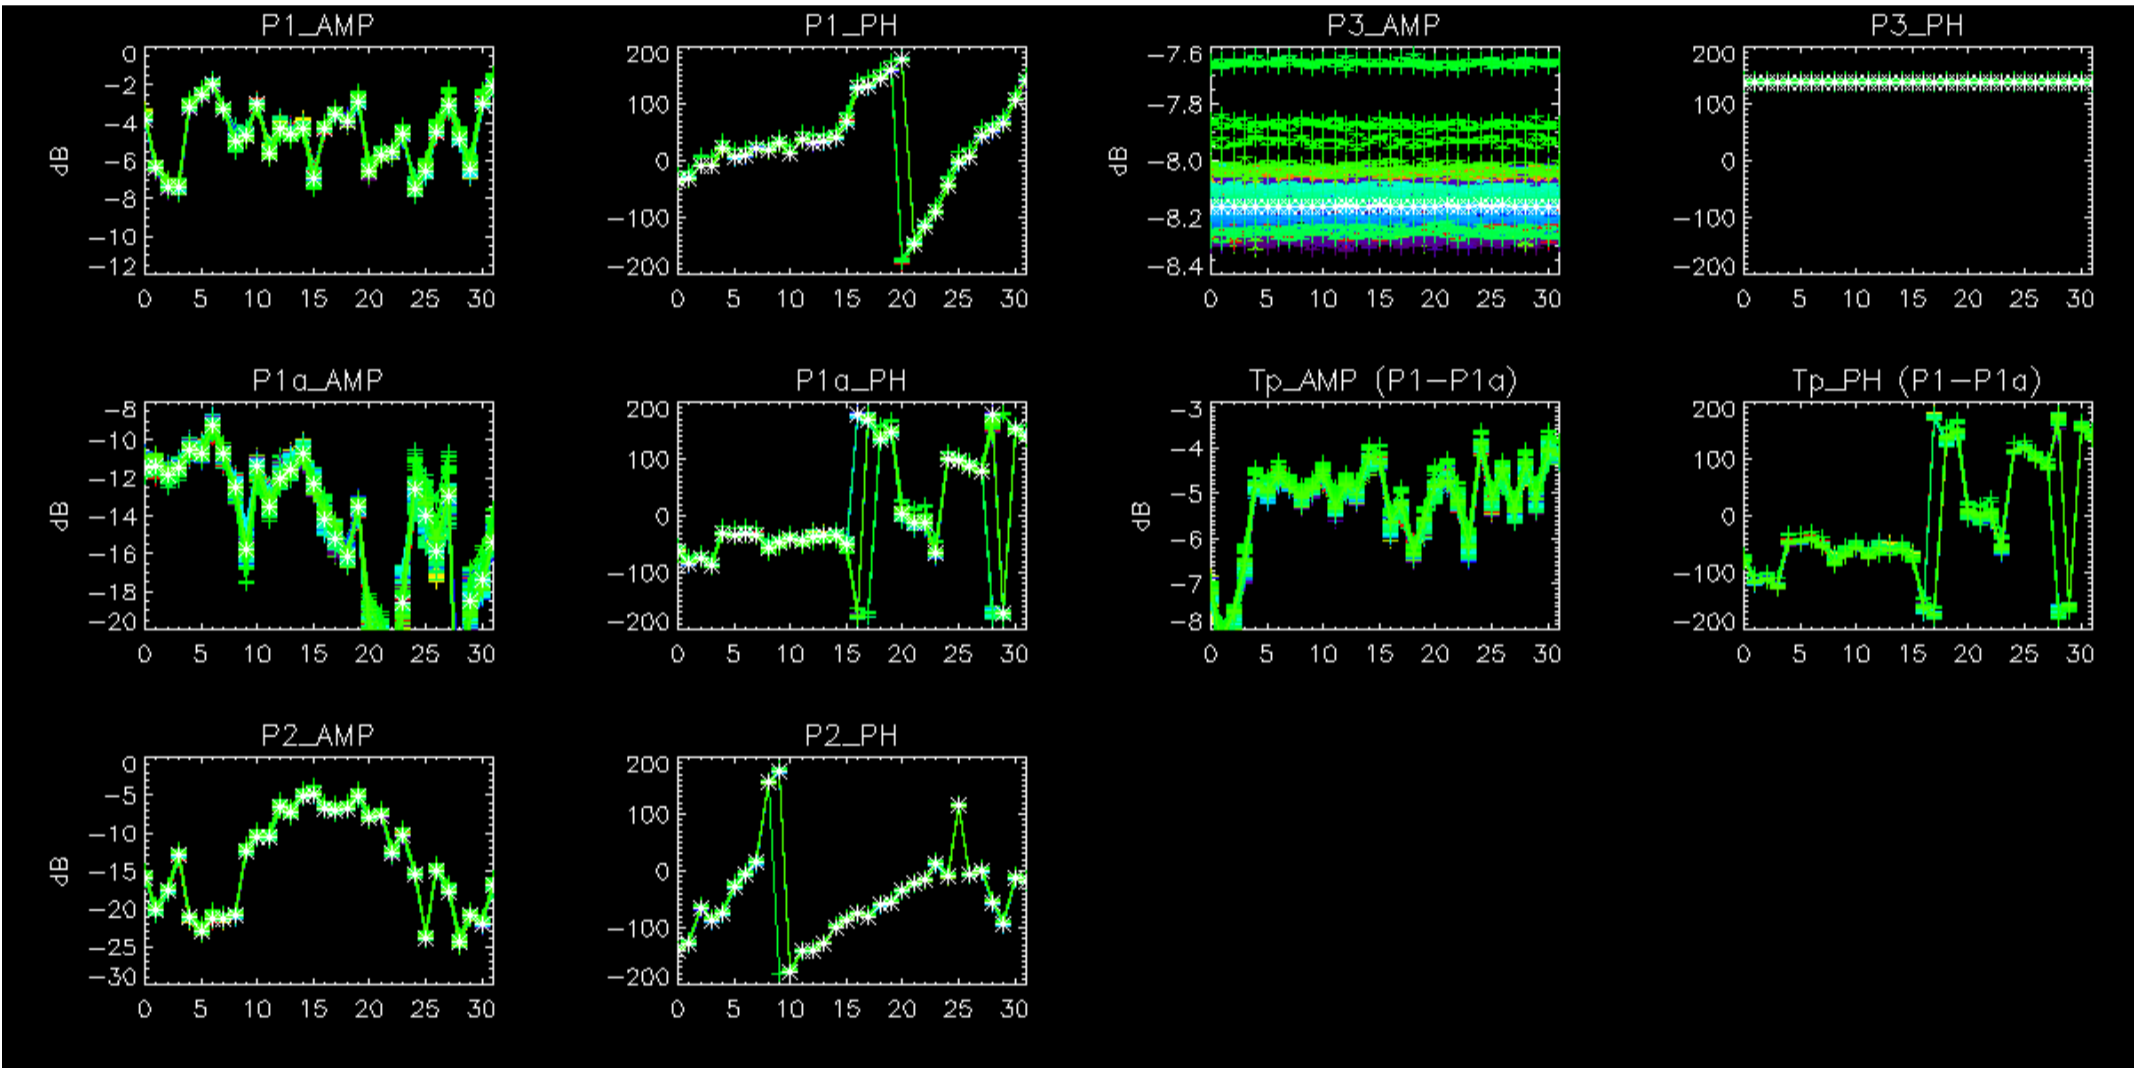



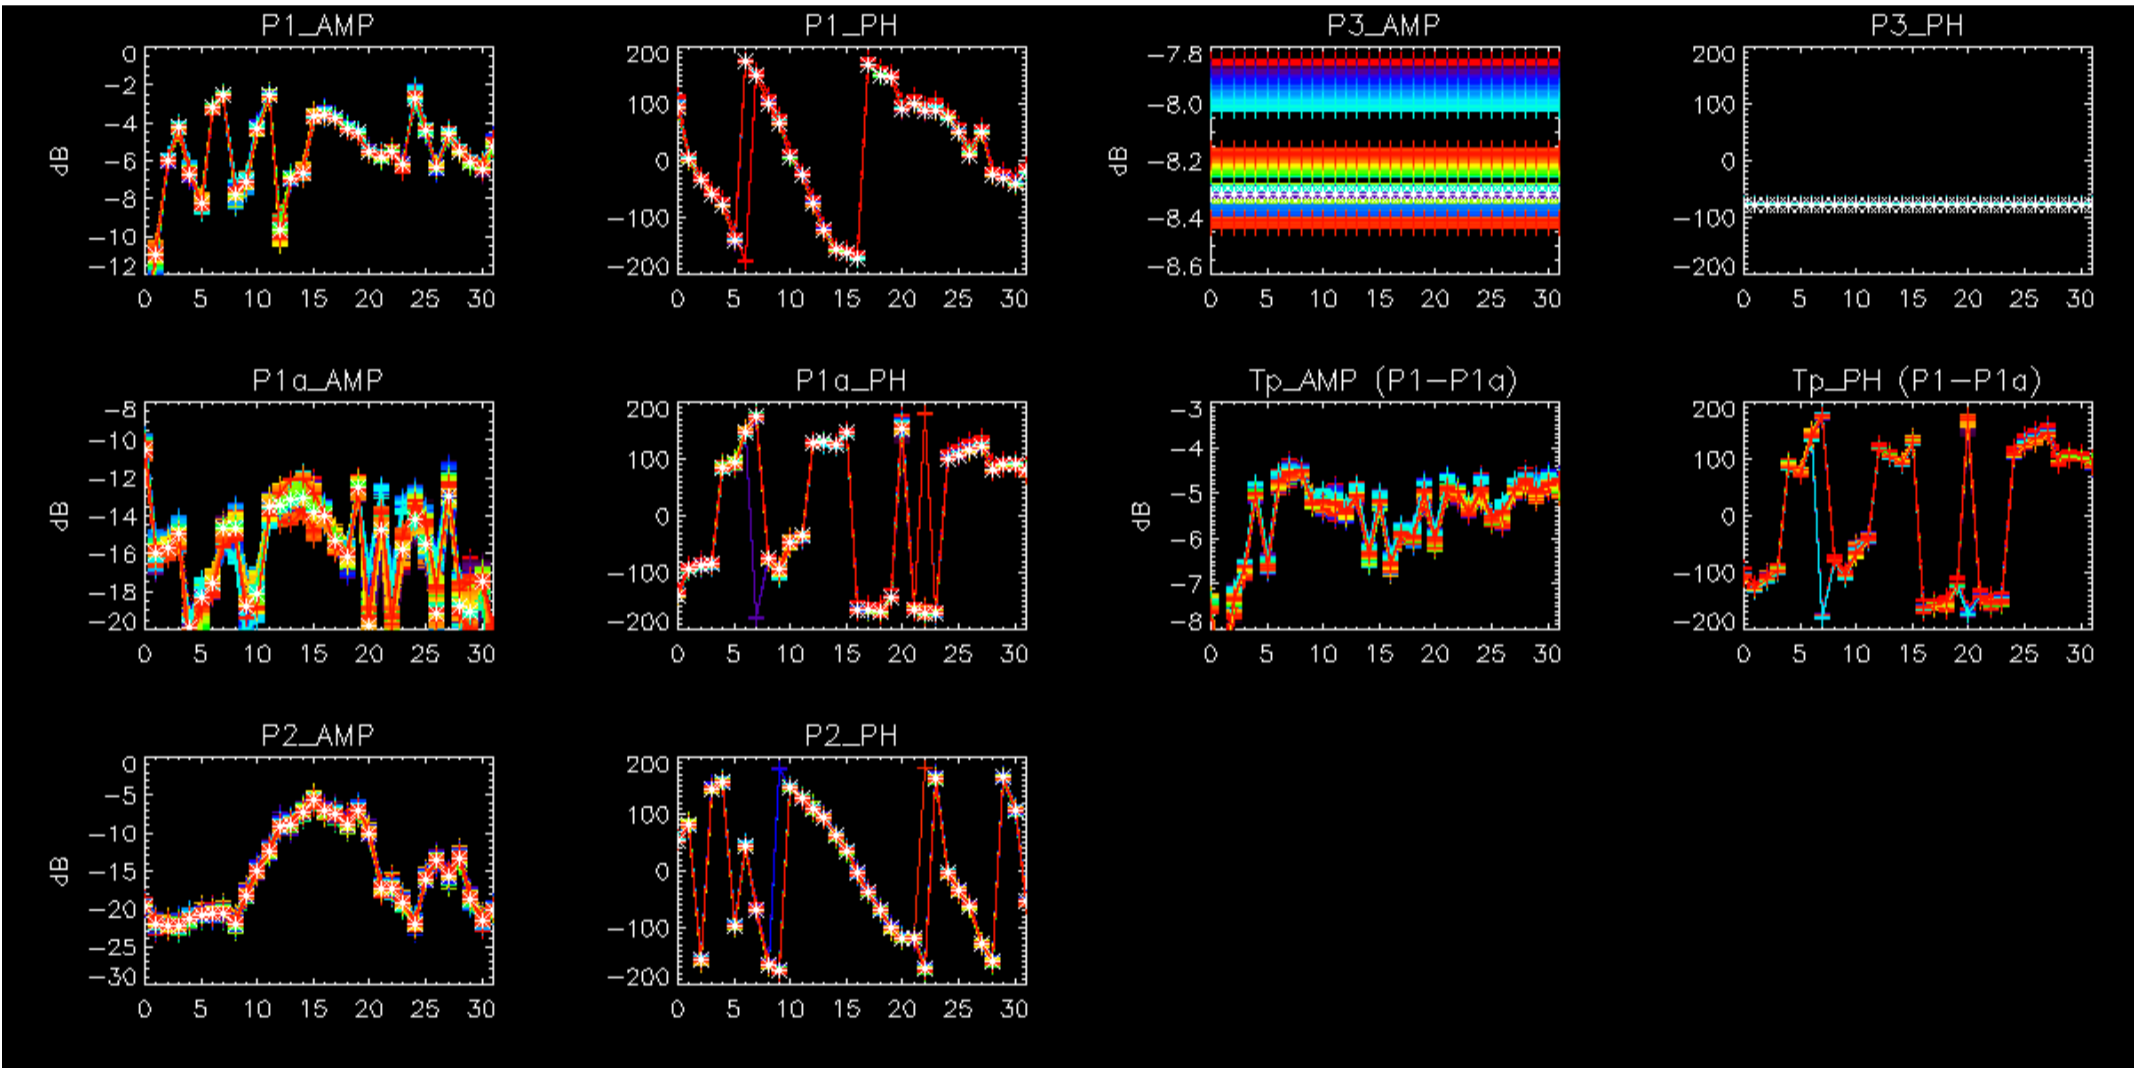


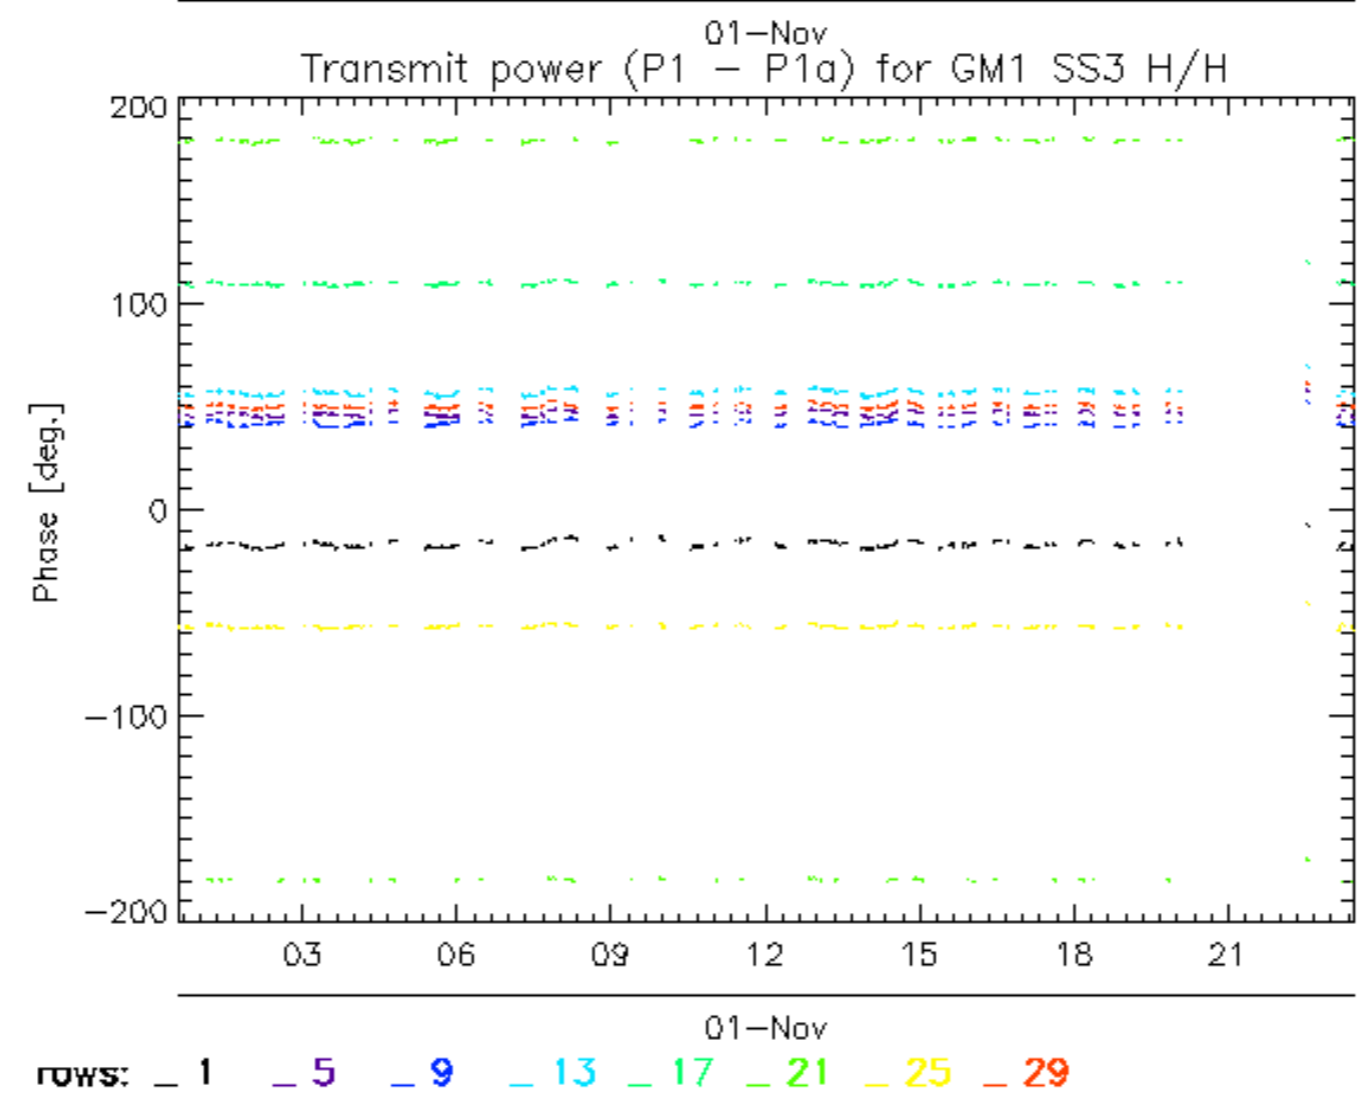
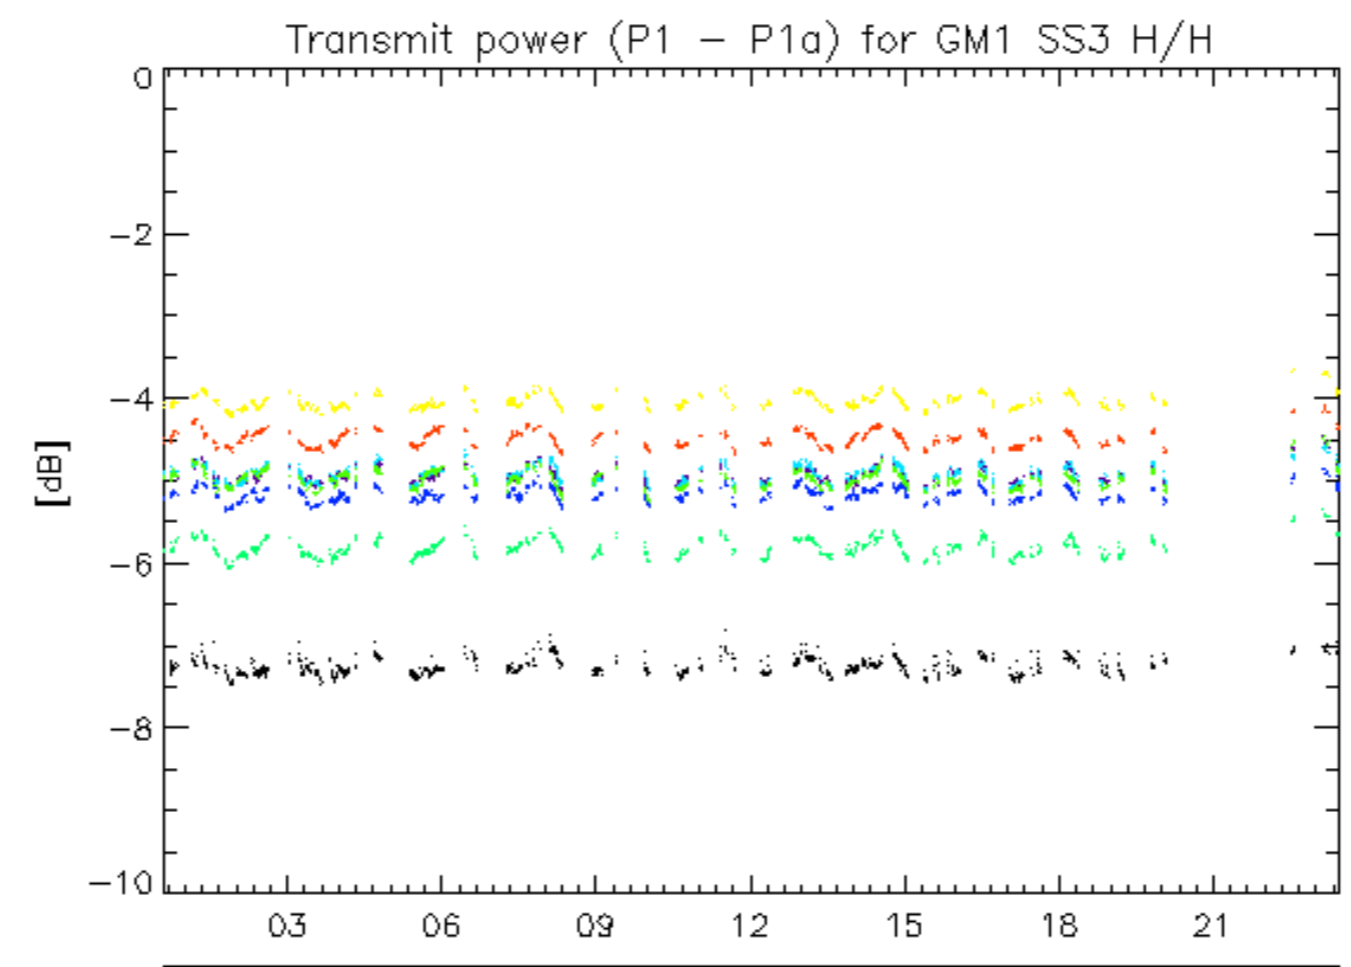


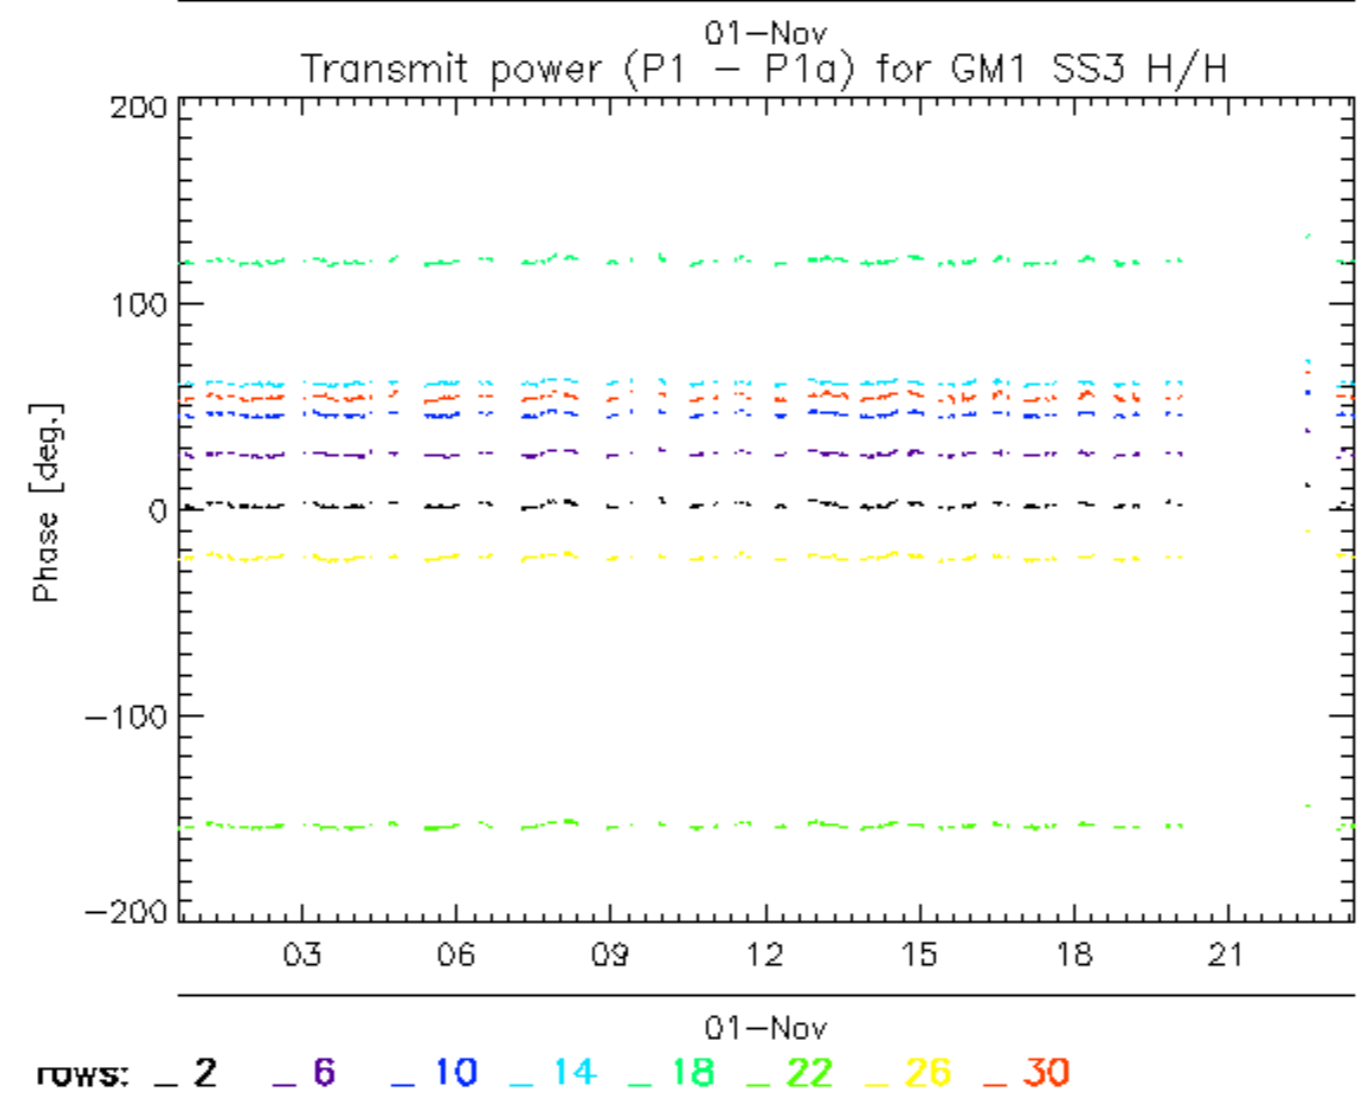
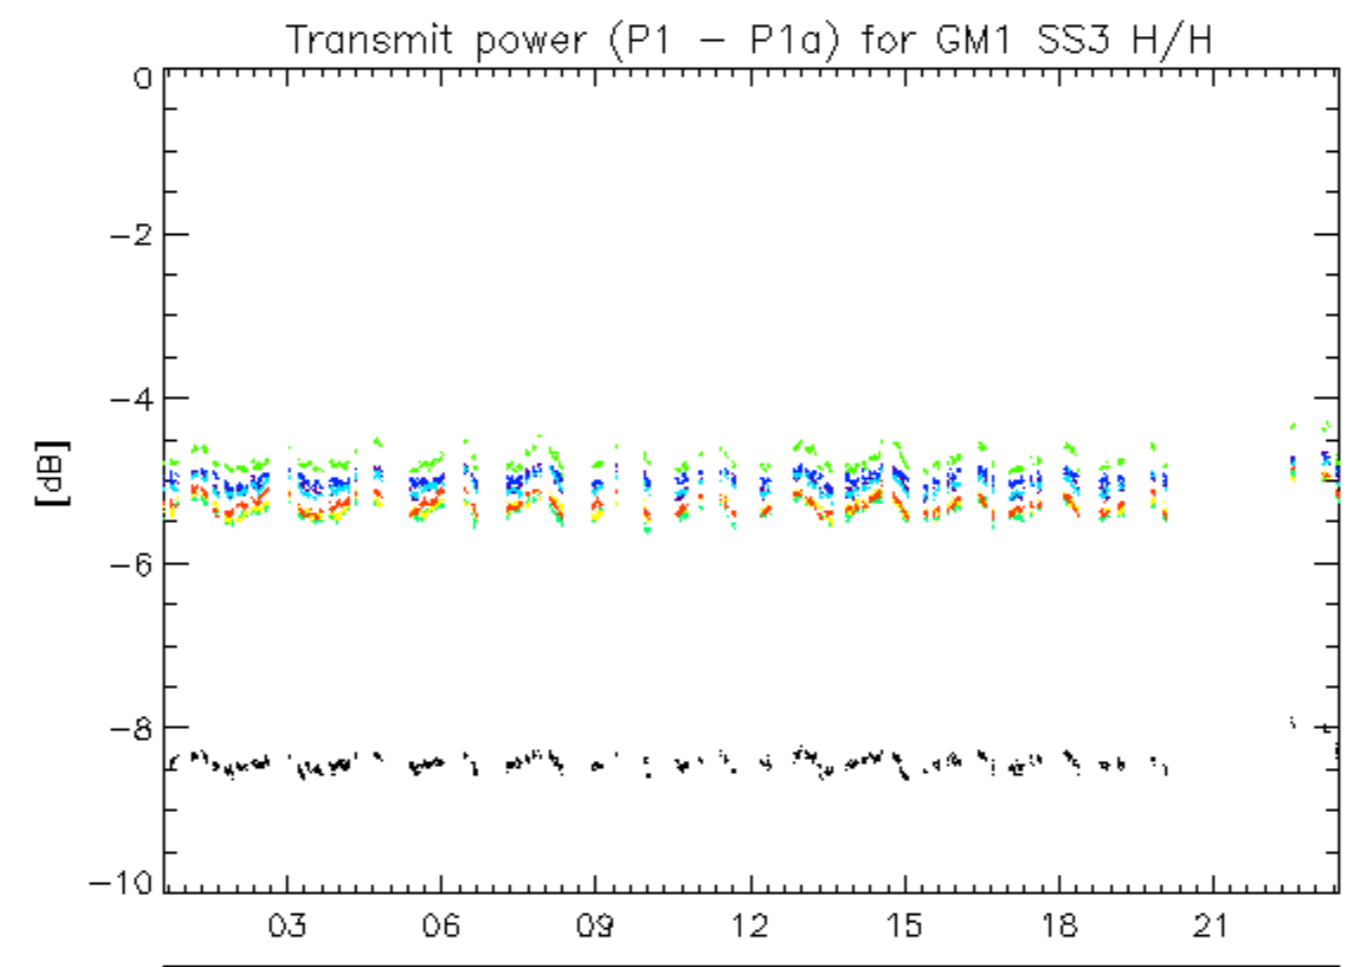


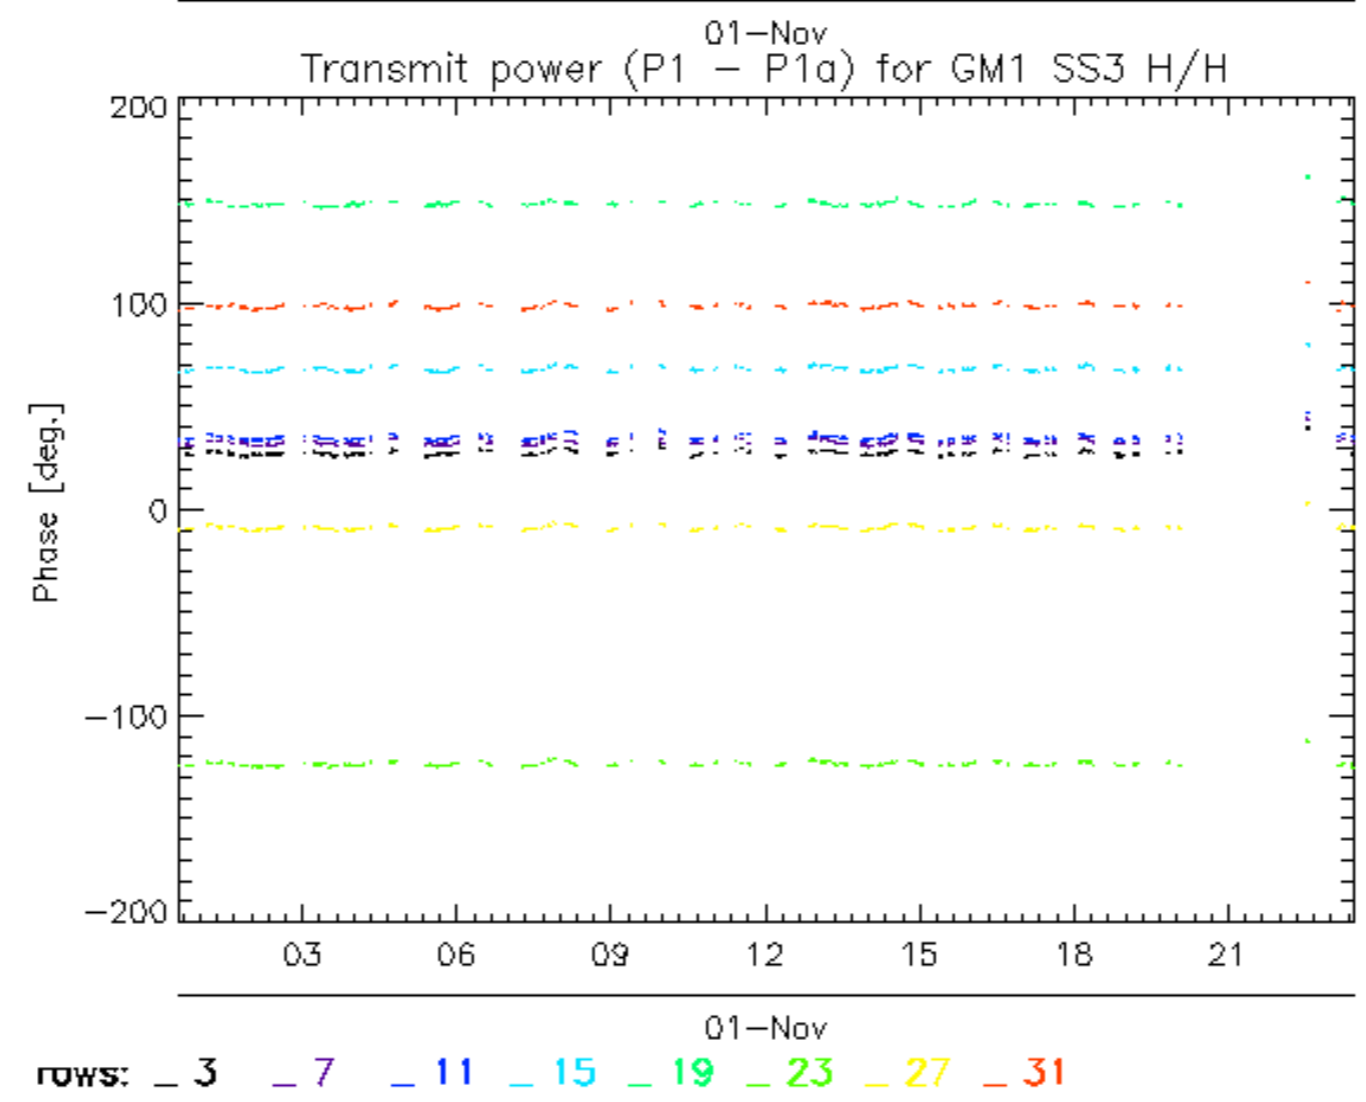
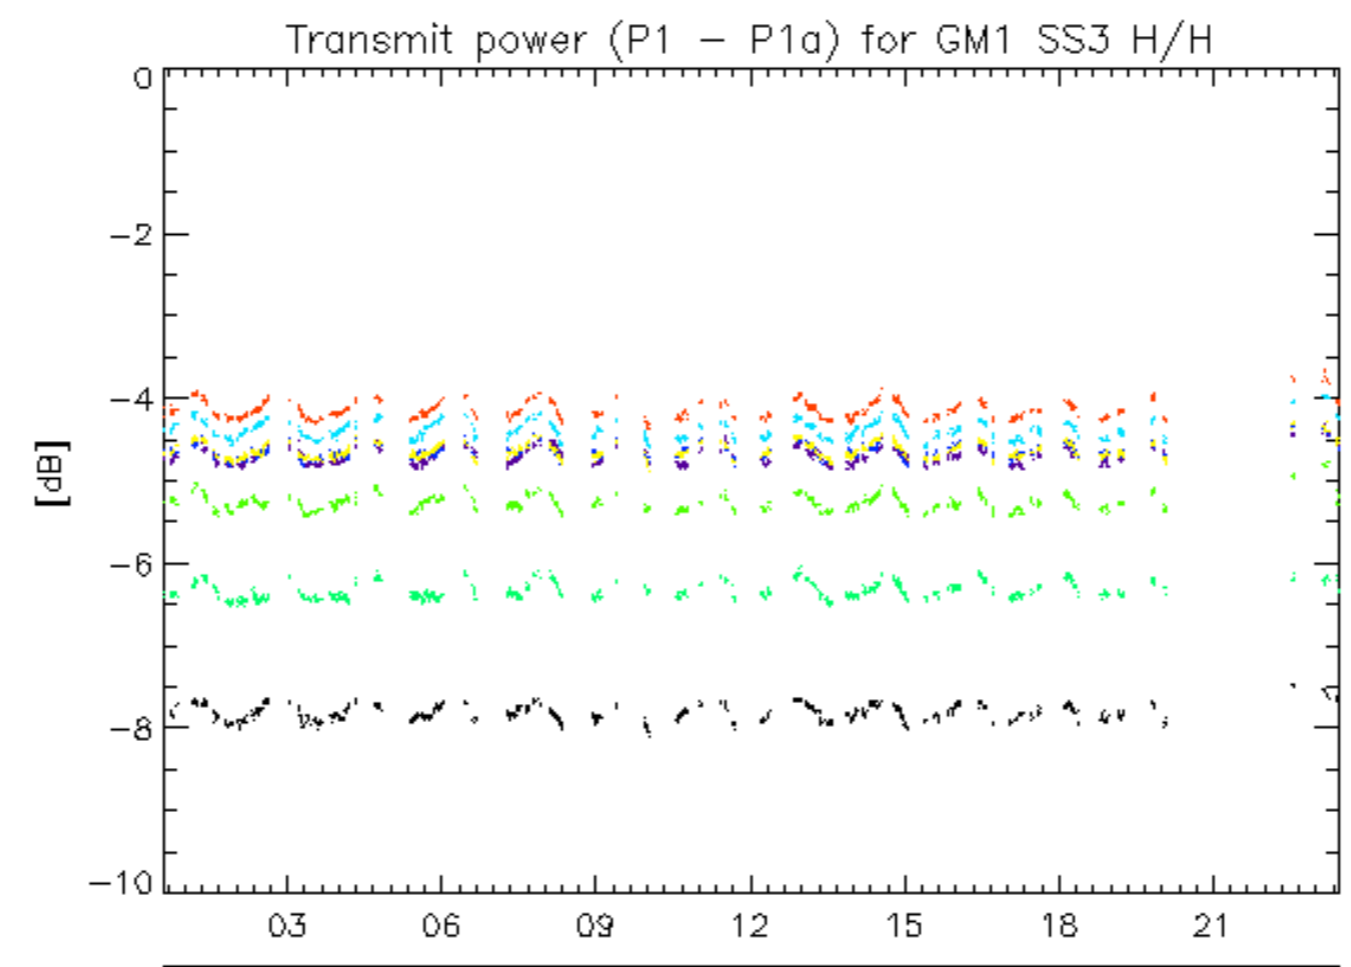


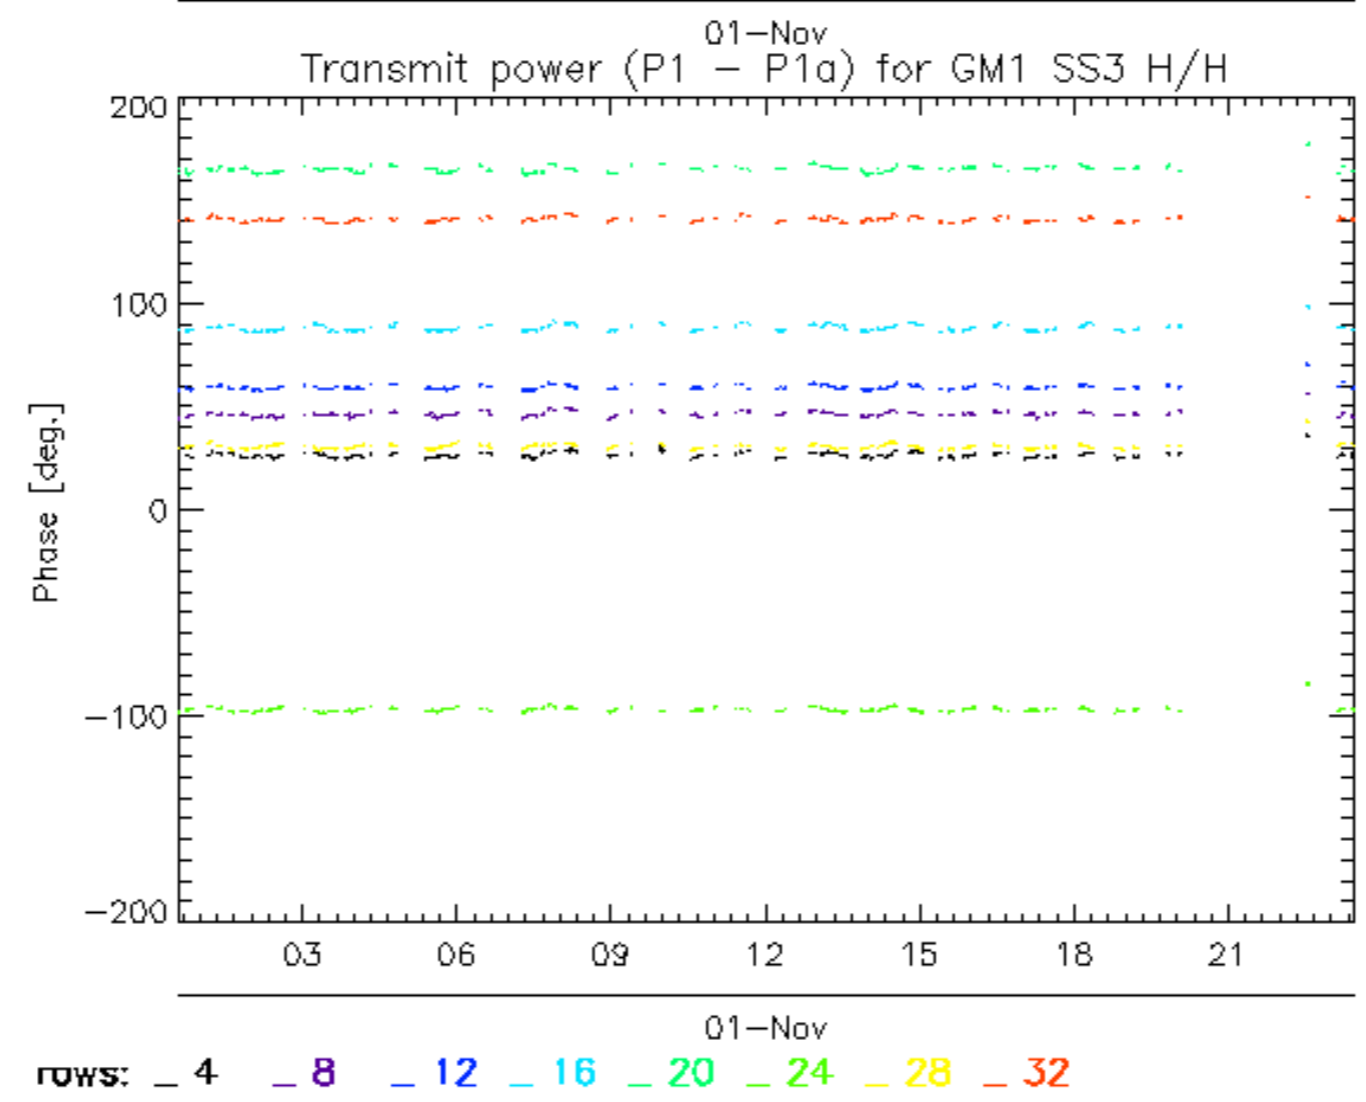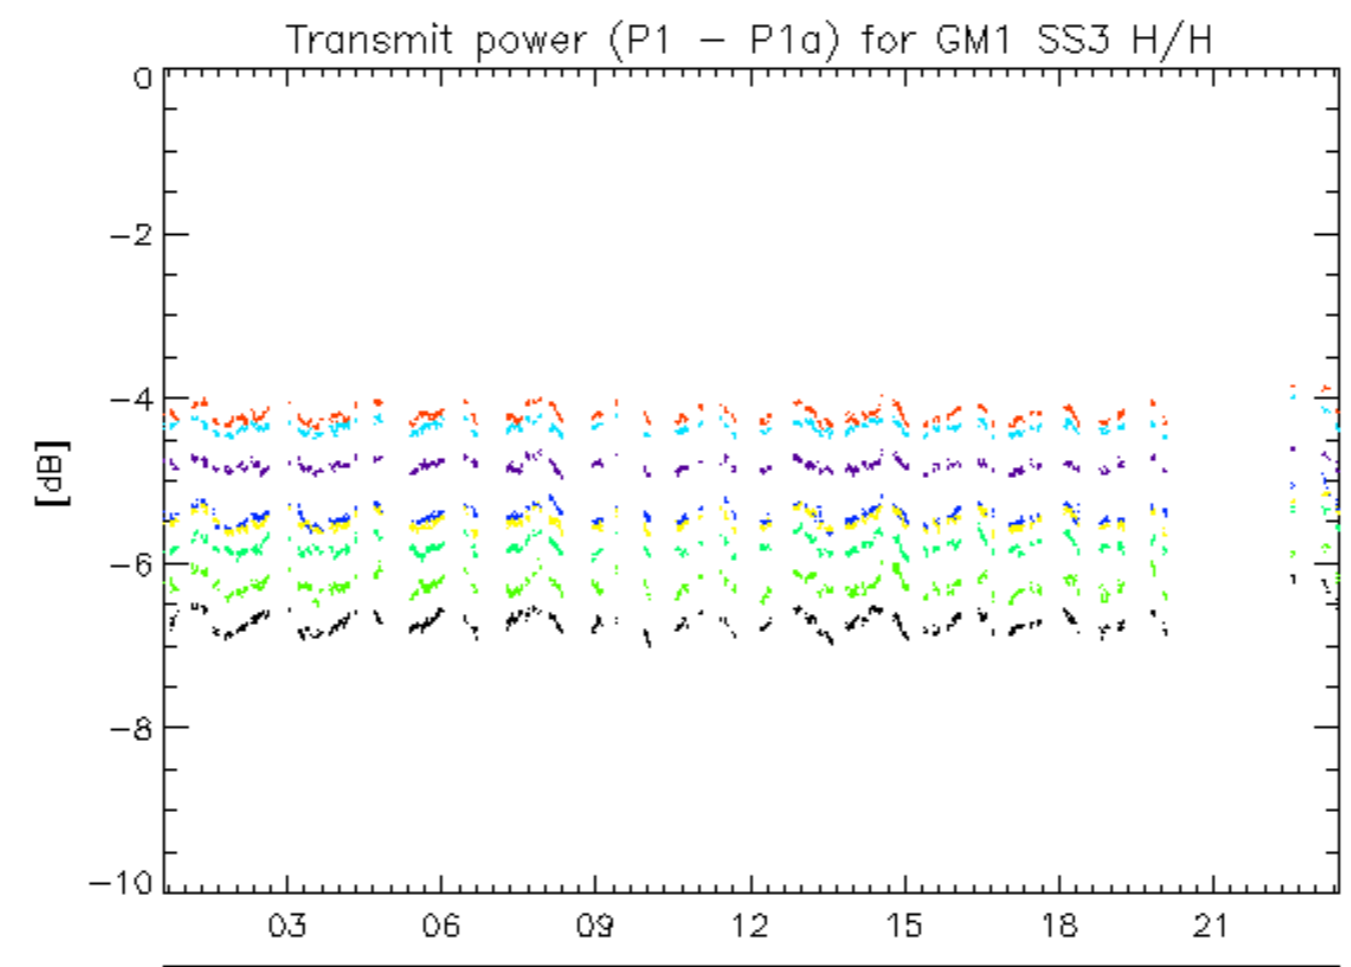

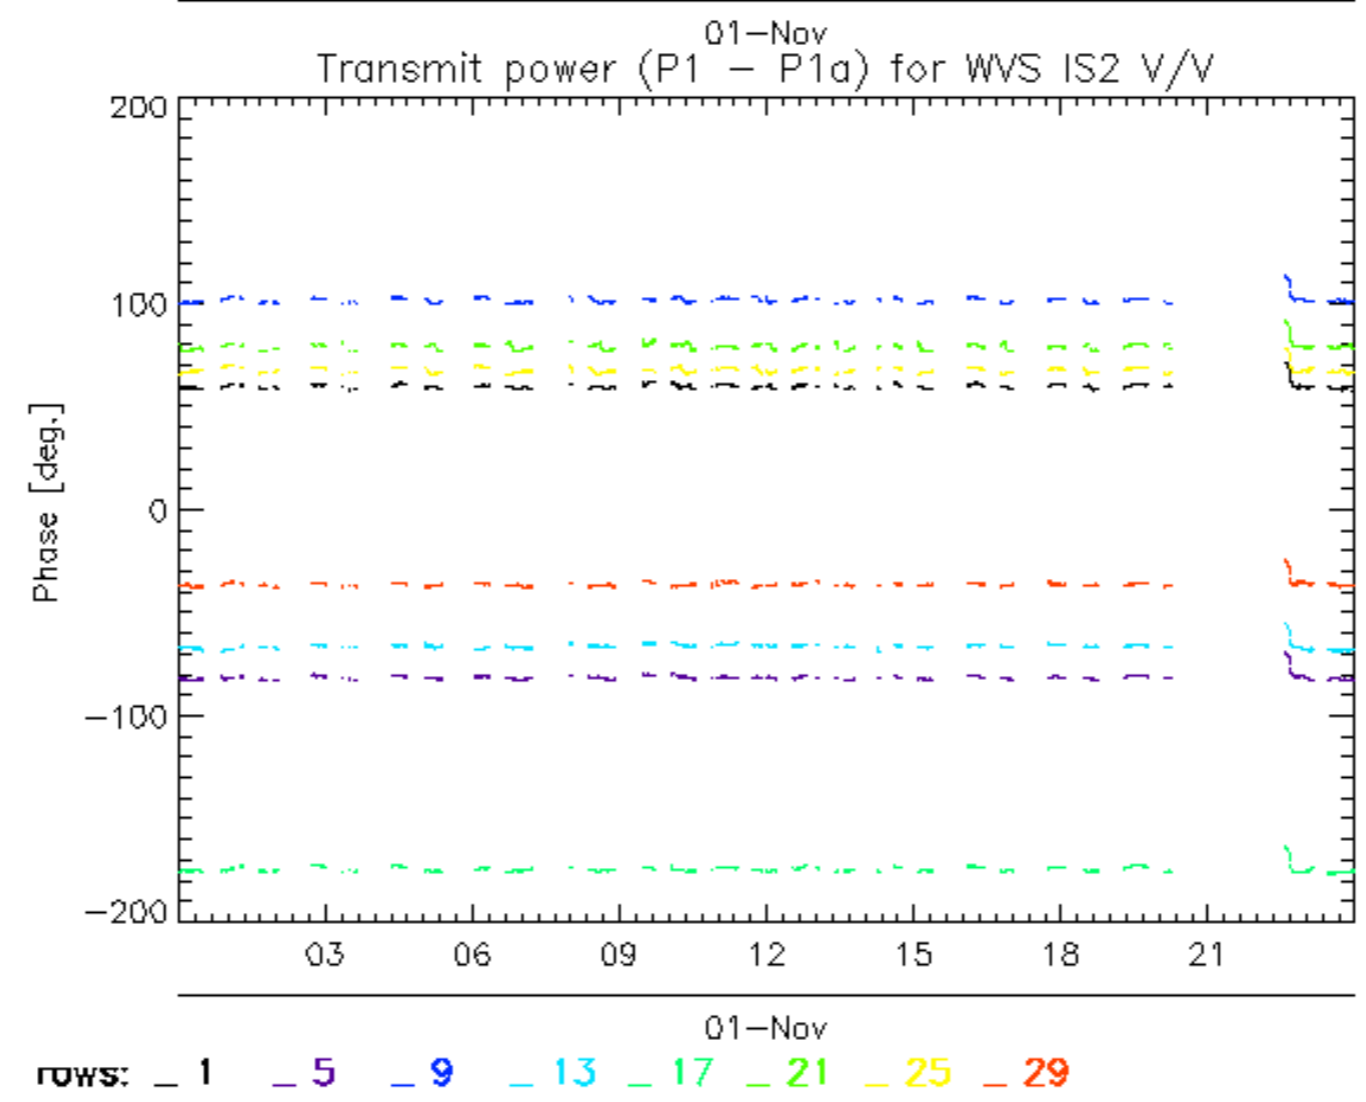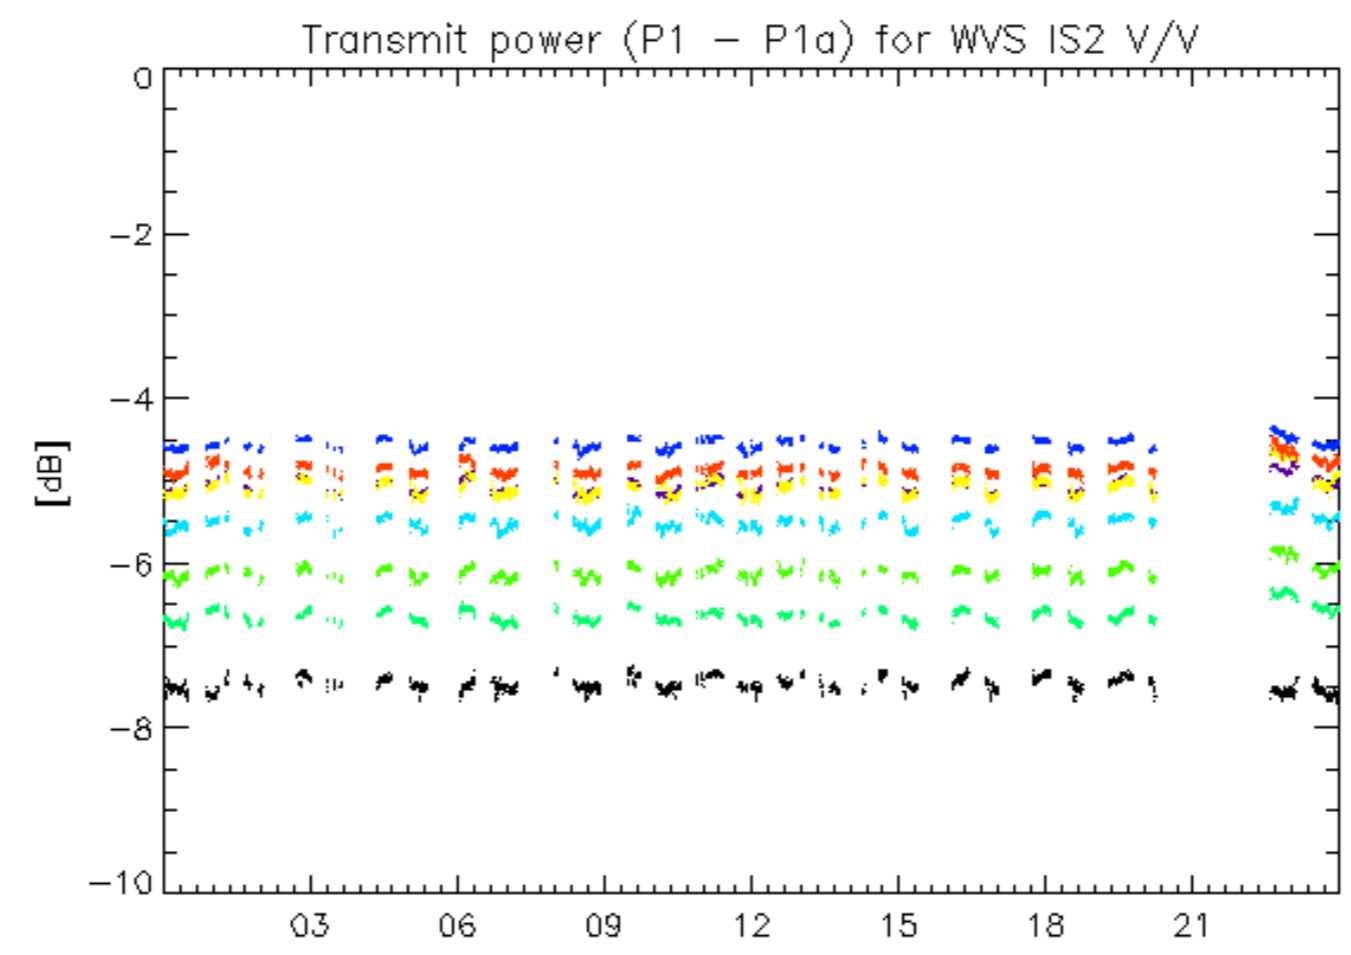


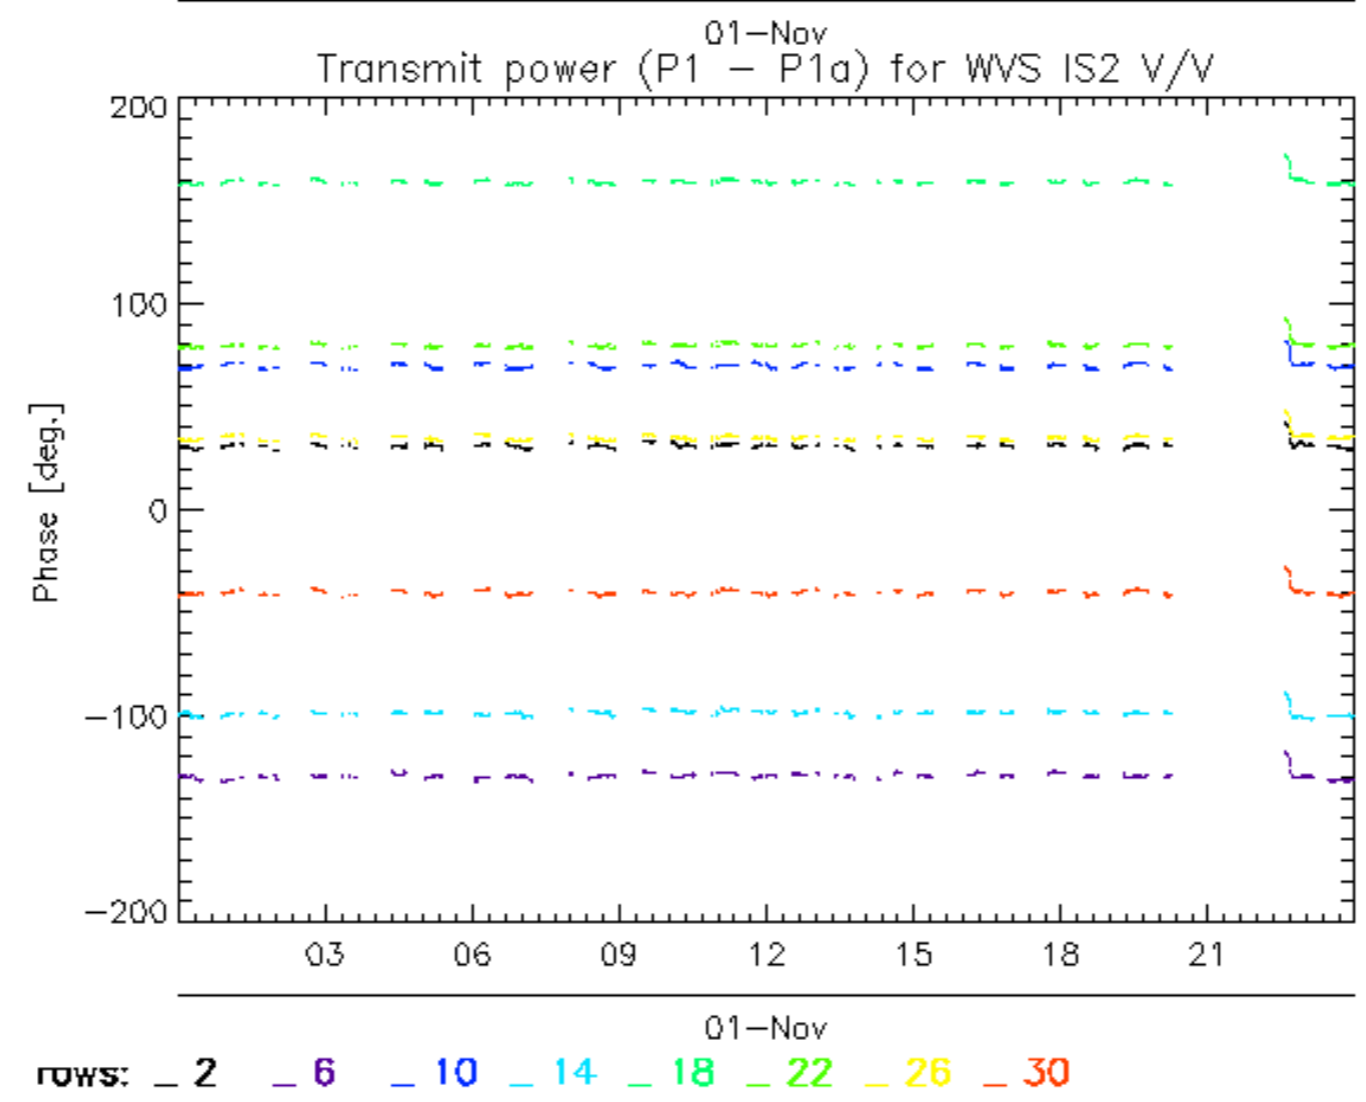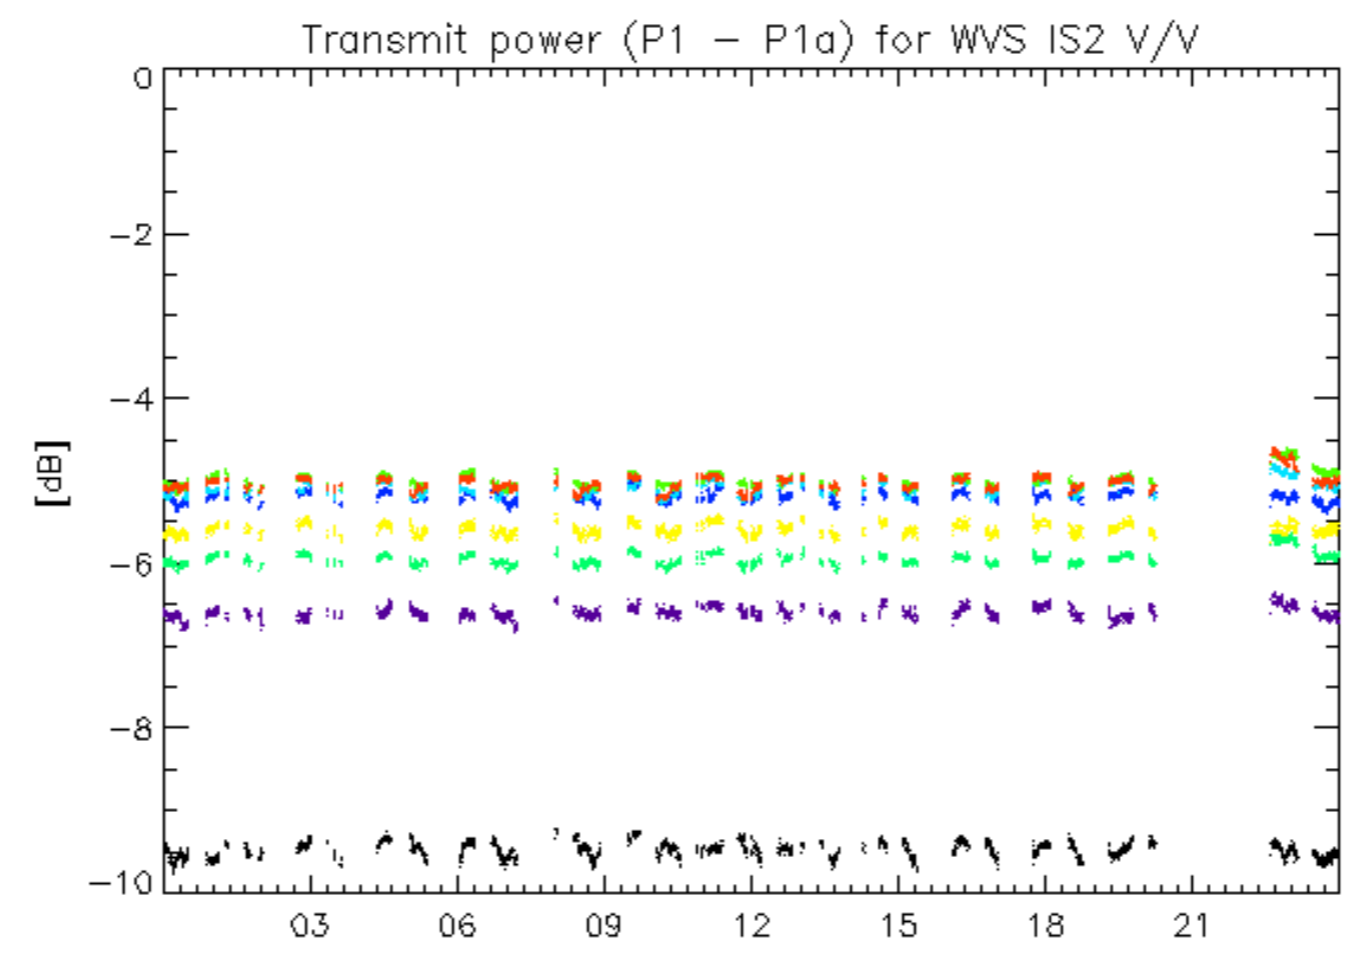


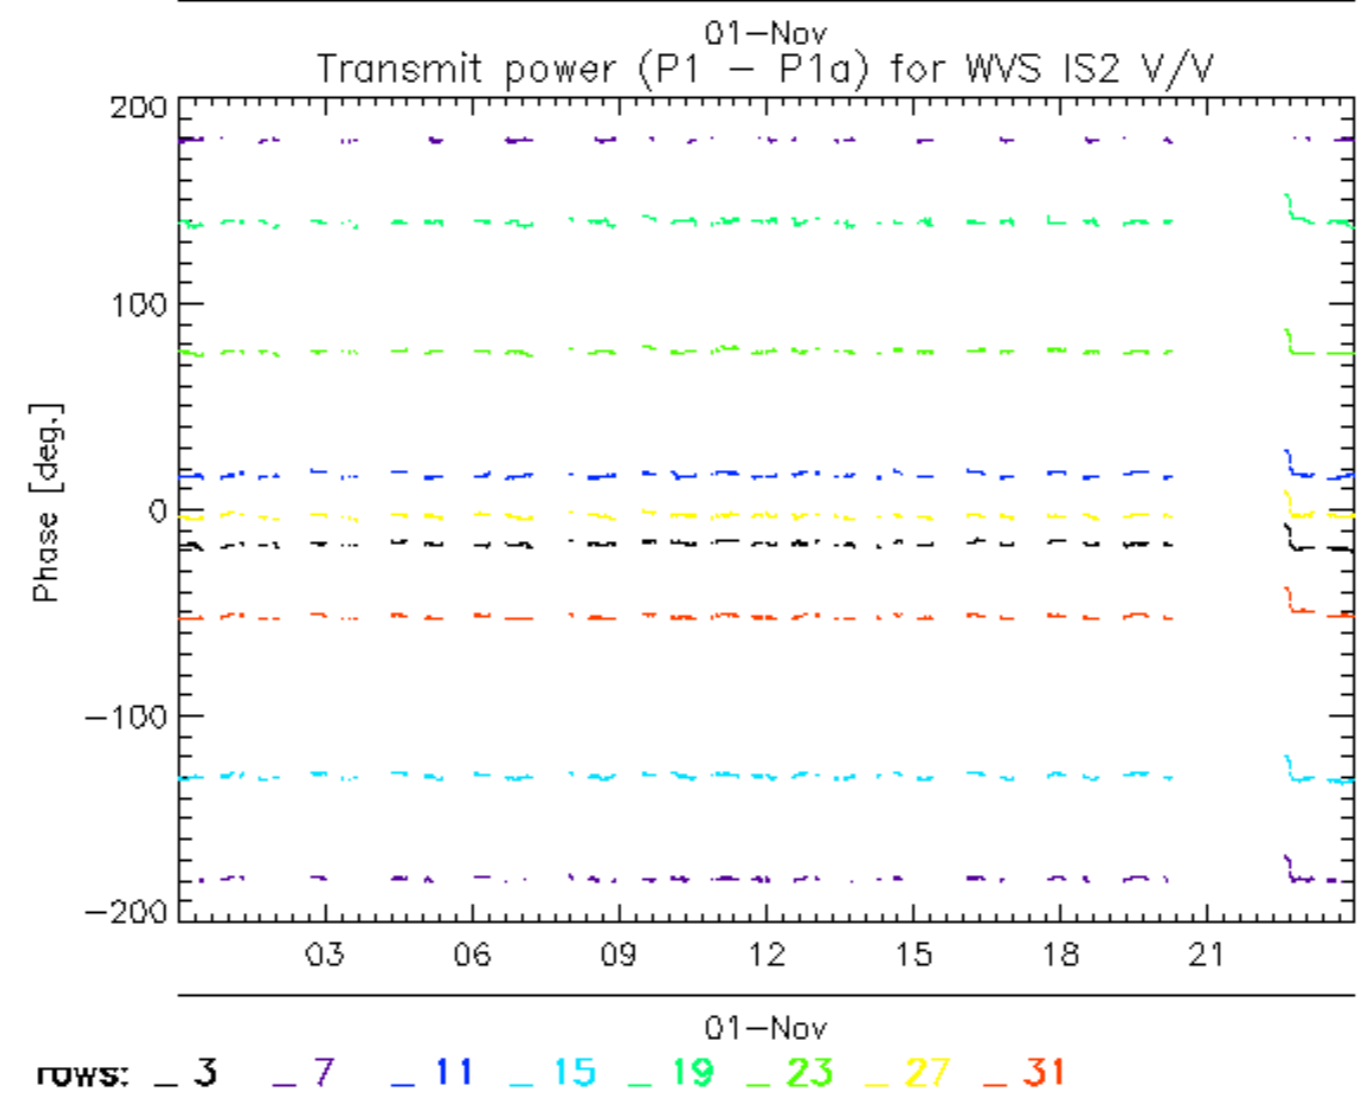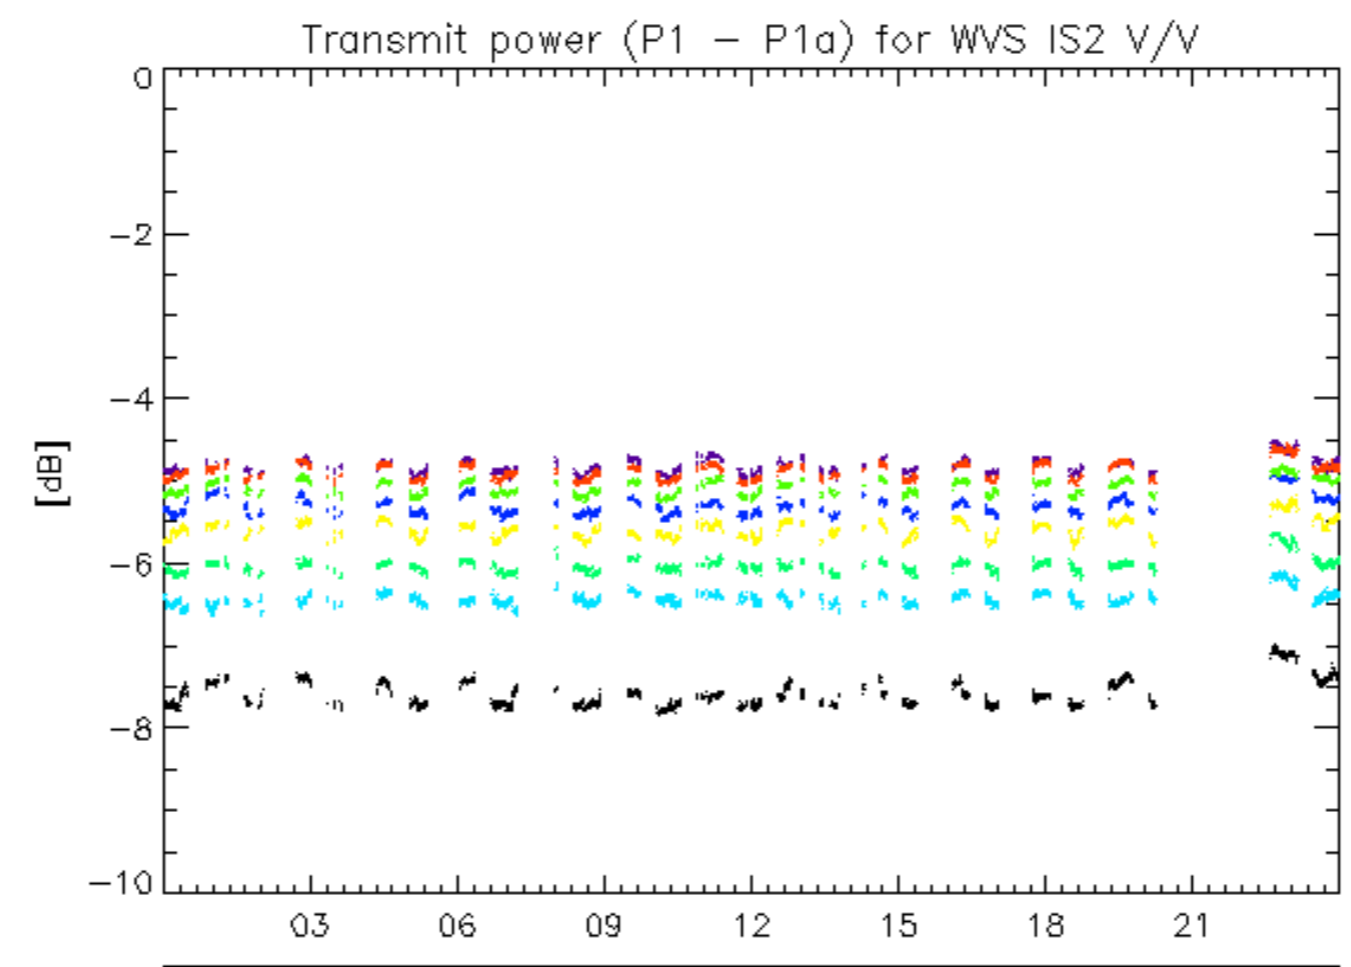


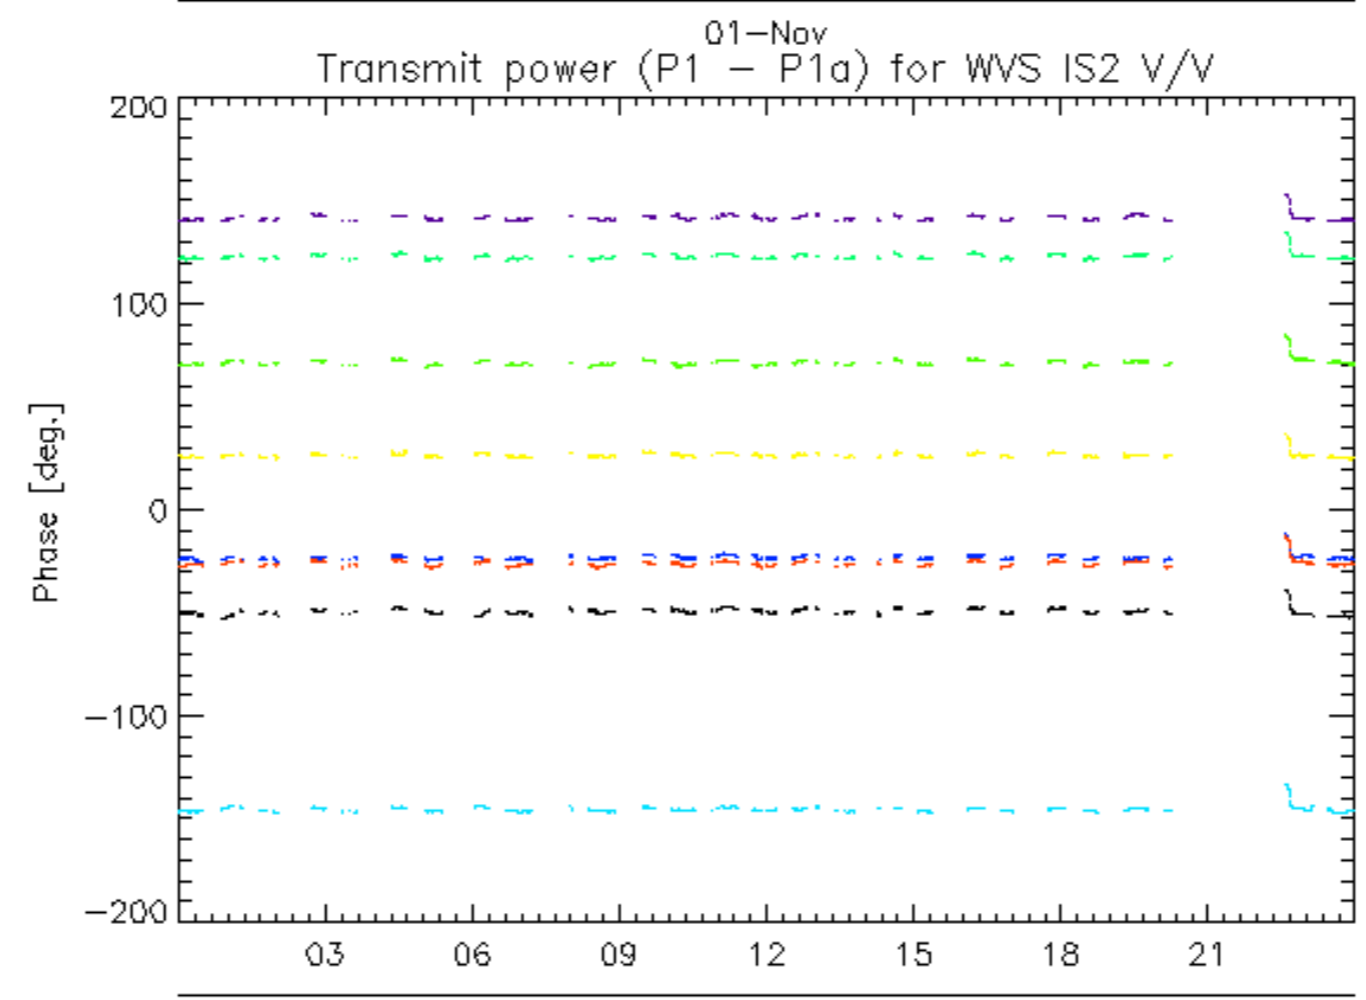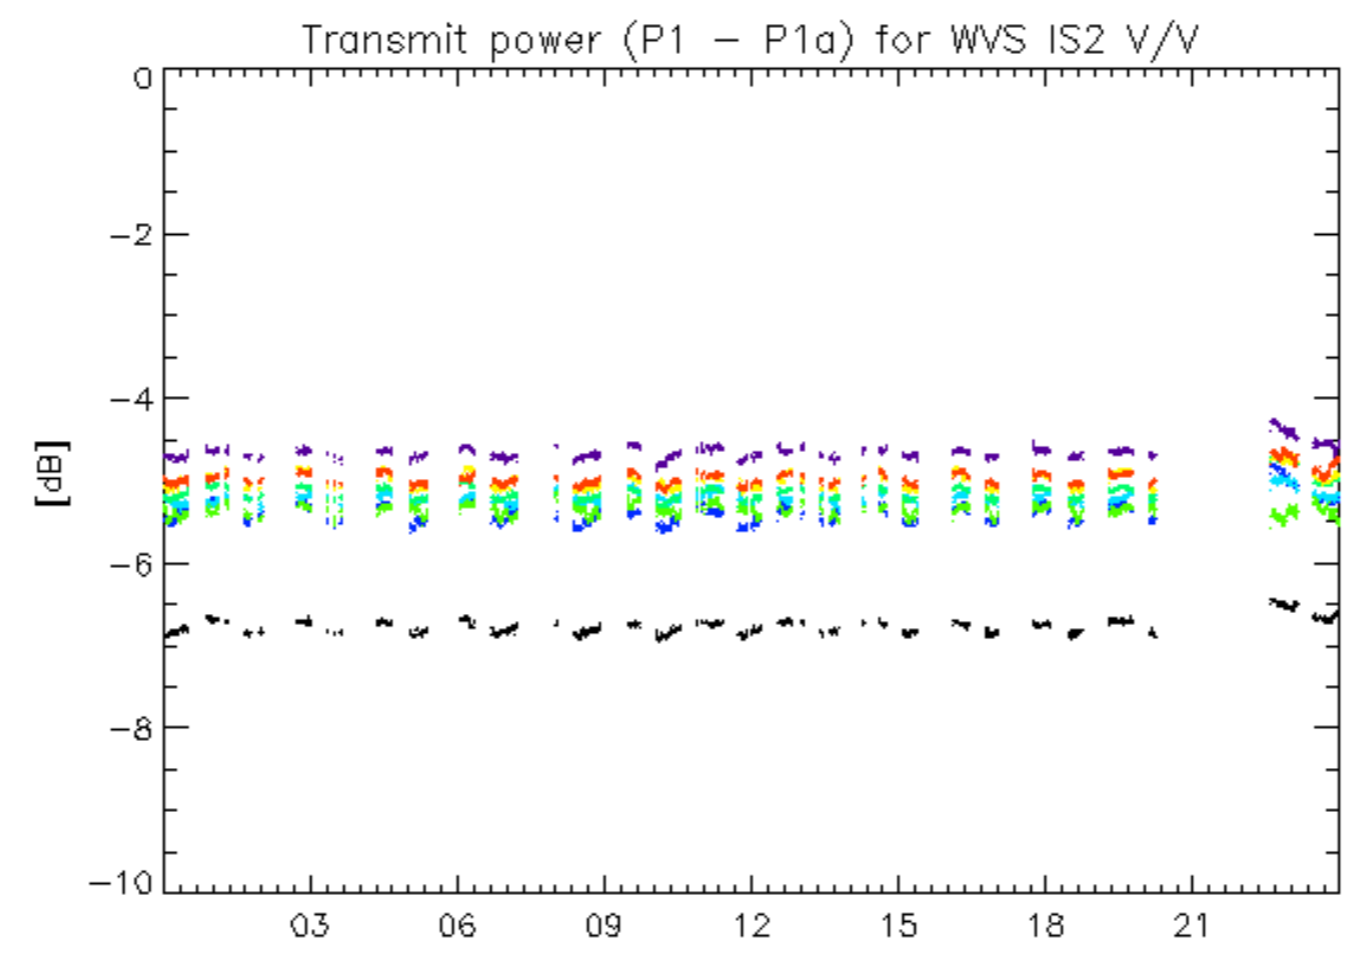


01-Nov
rows: _ 4 _ 8 _ 12 _ 16 _ 20 _ 24 _ 28 _ 32

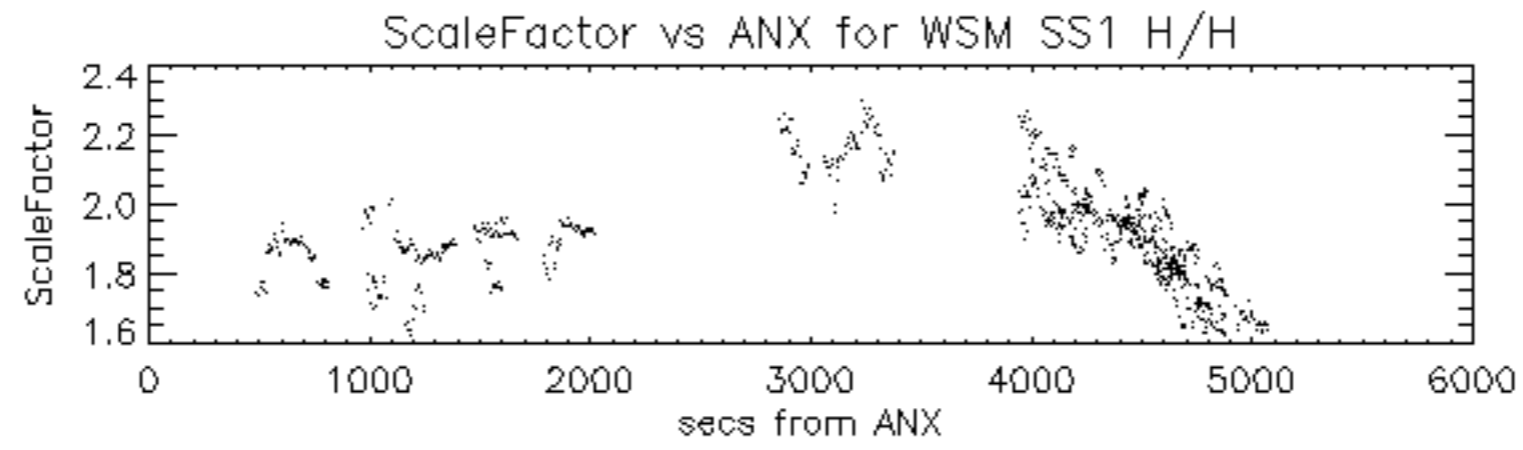

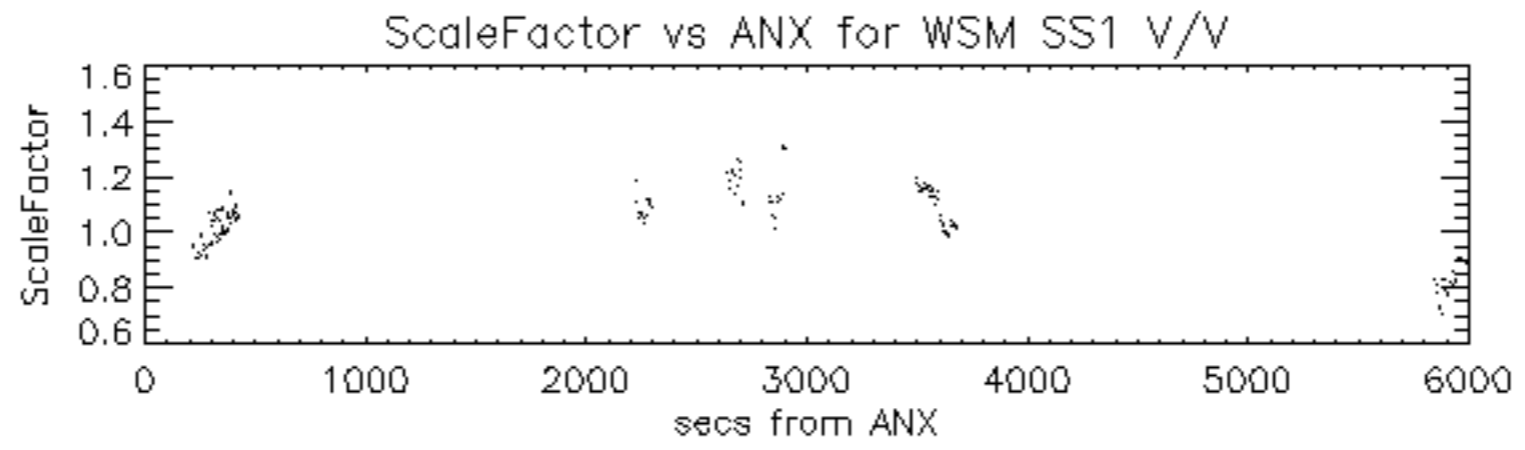

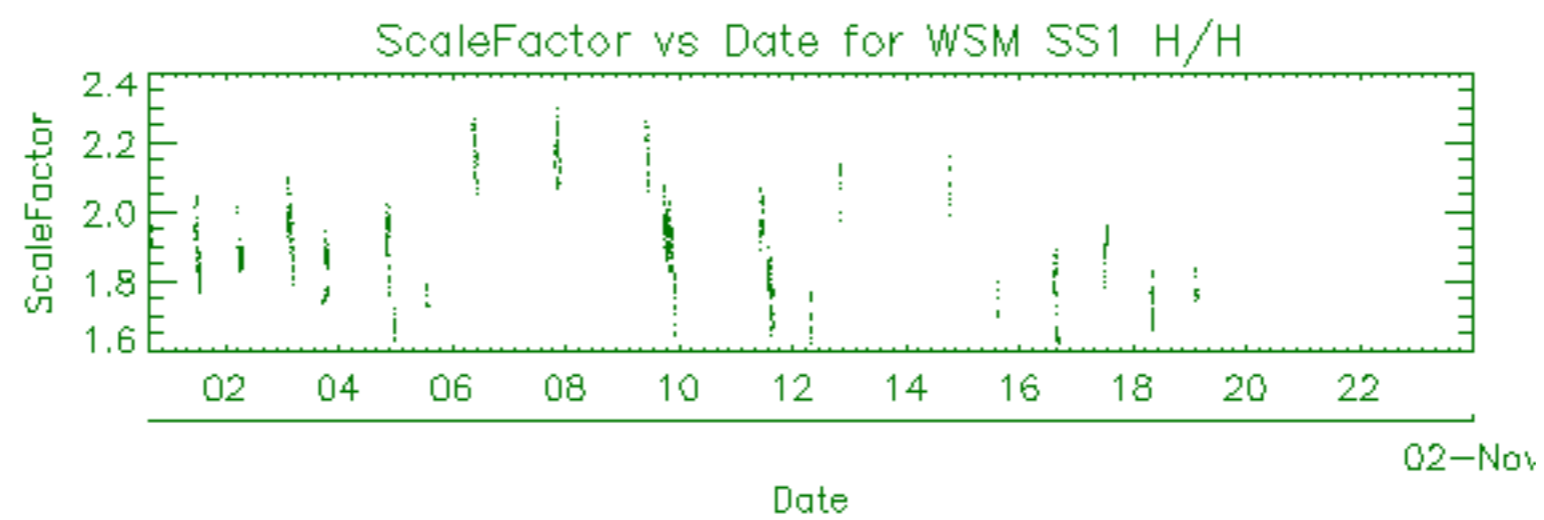

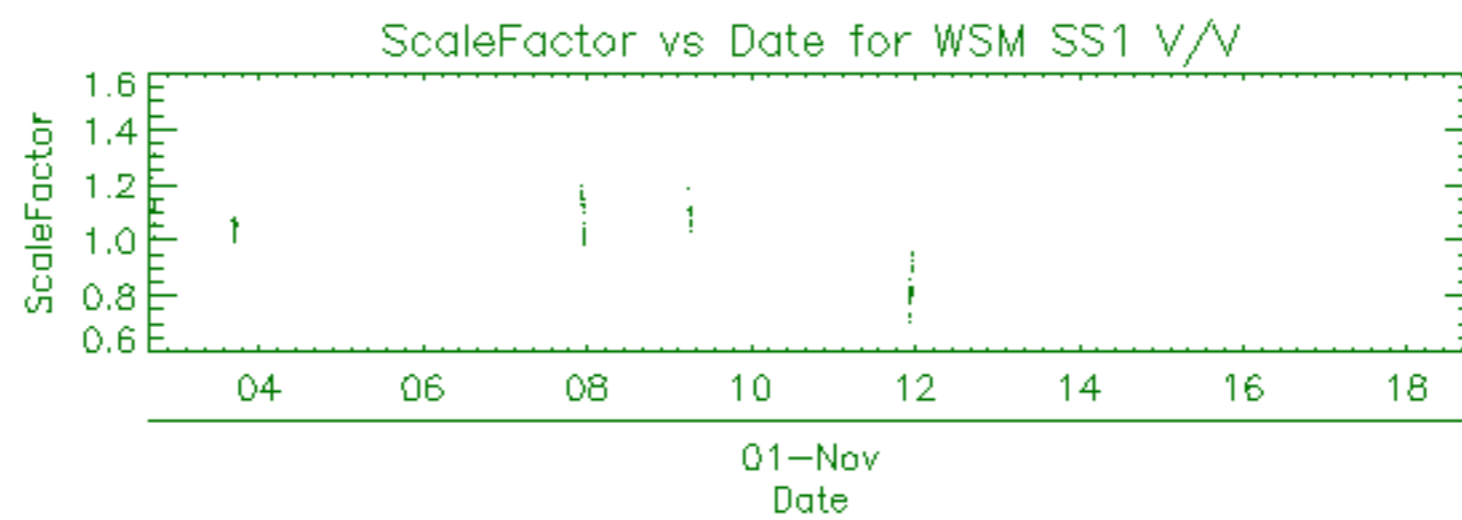

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_APM_1PNPDE20081101_074303_000001822073_00264_34887_7539.N1						IS4	H/V	73	34887	264	4.07
ASA_APM_1PNPDK20081101_134800_000000432073_00268_34891_9913.N1						IS2	H/H	73	34891	268	4.07
ASA_APM_1PNPDE20081101_201512_000000602073_00271_34894_7931.N1						IS2	H/H	73	34894	271	4.07

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_GM1_1PNPDE20081101_003537_000000722073_00260_34883_6827.N1						SS1	H/H	73	34883	260	4.07
ASA_GM1_1PNPDE20081101_004246_000003682073_00260_34883_6829.N1						SS1	H/H	73	34883	260	4.07
ASA_GM1_1PNPDE20081101_005010_000000962073_00260_34883_6831.N1						SS1	H/H	73	34883	260	4.07
ASA_GM1_1PNPDE20081101_010855_000003622073_00260_34883_6836.N1						SS1	H/H	73	34883	260	4.07
ASA_GM1_1PNPDE20081101_012031_000004282073_00260_34883_6846.N1						SS1	H/H	73	34883	260	4.07
ASA_GM1_1PNPDE20081101_013410_000003202073_00260_34883_6844.N1						SS1	H/H	73	34883	260	4.07
ASA_GM1_1PNPDE20081101_014642_000006342073_00260_34883_6982.N1						SS1	H/H	73	34883	260	4.07
ASA_GM1_1PNPDE20081101_020124_000007062073_00261_34884_6989.N1						SS1	H/H	73	34884	261	4.07
ASA_GM1_1PNPDE20081101_021837_000012262073_00261_34884_7053.N1						SS1	H/H	73	34884	261	4.07
ASA_GM1_1PNPDE20081101_030107_000000842073_00261_34884_7094.N1						SS1	H/H	73	34884	261	4.07
ASA_GM1_1PNPDE20081101_031245_000004412073_00261_34884_7106.N1						SS1	H/H	73	34884	261	4.07
ASA_GM1_1PNPDE20081101_032138_000002592073_00261_34884_7104.N1						SS1	H/H	73	34884	261	4.07
ASA_GM1_1PNPDE20081101_032600_000001022073_00261_34884_7099.N1						SS1	H/H	73	34884	261	4.07
ASA_GM1_1PNPDE20081101_033058_000003022073_00261_34884_7113.N1						SS1	H/H	73	34884	261	4.07
ASA_GM1_1PNPDE20081101_033822_000001262073_00262_34885_7108.N1						SS1	H/H	73	34885	262	4.07
ASA_GM1_1PNPDE20081101_034947_000014022073_00262_34885_7196.N1						SS1	H/H	73	34885	262	4.07
ASA_GM1_1PNPDE20081101_041937_000001322073_00262_34885_7143.N1						SS1	H/H	73	34885	262	4.07
ASA_GM1_1PNPDE20081101_044143_000004592073_00262_34885_7354.N1						SS1	H/H	73	34885	262	4.07
ASA_GM1_1PNPDE20081101_052313_000005922073_00263_34886_7352.N1						SS1	H/H	73	34886	263	4.07
ASA_GM1_1PNPDE20081101_053444_000007732073_00263_34886_7356.N1						SS1	H/H	73	34886	263	4.07
ASA_GM1_1PNPDE20081101_054824_000007972073_00263_34886_7390.N1						SS1	H/H	73	34886	263	4.07
ASA_GM1_1PNPDK20081101_062636_000001442073_00263_34886_9284.N1						SS1	H/H	73	34886	263	4.07
ASA_GM1_1PNPDK20081101_063557_000003202073_00263_34886_9294.N1						SS1	H/H	73	34886	263	4.07
ASA_GM1_1PNPDK20081101_071541_000005552073_00264_34887_9319.N1						SS1	H/H	73	34887	264	4.07
ASA_GM1_1PNPDK20081101_072347_000005862073_00264_34887_9389.N1						SS1	H/H	73	34887	264	4.07
ASA_GM1_1PNPDK20081101_073824_000002772073_00264_34887_9391.N1						SS1	H/H	73	34887	264	4.07
ASA_GM1_1PNPDK20081101_074626_000001572073_00264_34887_9393.N1						SS1	H/H	73	34887	264	4.07
ASA_GM1_1PNPDK20081101_075339_000000842073_00264_34887_9395.N1						SS1	H/H	73	34887	264	4.07
ASA_GM1_1PNPDK20081101_080513_000010032073_00264_34887_9481.N1						SS1	H/H	73	34887	264	4.07
ASA_GM1_1PNPDK20081101_085534_000006222073_00265_34888_9404.N1						SS1	H/H	73	34888	265	4.07
ASA_GM1_1PNPDK20081101_090449_000001202073_00265_34888_9534.N1						SS1	H/H	73	34888	265	4.07
ASA_GM1_1PNPDK20081101_092326_000001022073_00265_34888_9536.N1						SS1	H/H	73	34888	265	4.07
ASA_GM1_1PNPDK20081101_095610_000003802073_00265_34888_9541.N1						SS1	H/H	73	34888	265	4.07
ASA_GM1_1PNPDK20081101_103349_000007372073_00266_34889_9551.N1						SS1	H/H	73	34889	266	4.07
ASA_GM1_1PNPDK20081101_104452_000001142073_00266_34889_9672.N1						SS1	H/H	73	34889	266	4.07
ASA_GM1_1PNPDK20081101_110051_000001692073_00266_34889_9677.N1						SS1	H/H	73	34889	266	4.07
ASA_GM1_1PNPDK20081101_112407_000001022073_00266_34889_9679.N1						SS1	H/H	73	34889	266	4.07
ASA_GM1_1PNPDK20081101_112925_000002232073_00266_34889_9681.N1						SS1	H/H	73	34889	266	4.07
ASA_GM1_1PNPDK20081101_113947_000001992073_00266_34889_9689.N1						SS1	H/H	73	34889	266	4.07
ASA_GM1_1PNPDK20081101_121224_000003382073_00267_34890_9694.N1						SS1	H/H	73	34890	267	4.07
ASA_GM1_1PNPDK20081101_122000_000001992073_00267_34890_9701.N1						SS1	H/H	73	34890	267	4.07
ASA_GM1_1PNPDK20081101_125112_000004412073_00267_34890_9812.N1						SS1	H/H	73	34890	267	4.07
ASA_GM1_1PNPDK20081101_125835_000001082073_00267_34890_9814.N1						SS1	H/H	73	34890	267	4.07
ASA_GM1_1PNPDK20081101_130442_000007182073_00267_34890_9819.N1						SS1	H/H	73	34890	267	4.07
ASA_GM1_1PNPDK20081101_131929_000002532073_00267_34890_9824.N1						SS1	H/H	73	34890	267	4.07
ASA_GM1_1PNPDK20081101_132803_000004652073_00267_34890_9834.N1						SS1	H/H	73	34890	267	4.07
ASA_GM1_1PNPDK20081101_135046_000001202073_00268_34891_9832.N1						SS1	H/H	73	34891	268	4.07
ASA_GM1_1PNPDK20081101_135332_000006702073_00268_34891_9844.N1						SS1	H/H	73	34891	268	4.07
ASA_GM1_1PNPDK20081101_140332_000001322073_00268_34891_9963.N1						SS1	H/H	73	34891	268	4.07
ASA_GM1_1PNPDK20081101_141103_000002772073_00268_34891_9965.N1						SS1	H/H	73	34891	268	4.07
ASA_GM1_1PNPDK20081101_141806_000008032073_00268_34891_9967.N1						SS1	H/H	73	34891	268	4.07
ASA_GM1_1PNPDK20081101_143255_000000902073_00268_34891_9972.N1						SS1	H/H	73	34891	268	4.07
ASA_GM1_1PNPDK20081101_144637_000010622073_00268_34891_0065.N1						SS1	H/H	73	34891	268	4.07
ASA_GM1_1PNPDK20081101_152243_000002352073_00269_34892_9986.N1						SS1	H/H	73	34892	269	4.07
ASA_GM1_1PNPDK20081101_153310_000000962073_00269_34892_9984.N1						SS1	H/H	73	34892	269	4.07
ASA_GM1_1PNPDK20081101_153725_000002412073_00269_34892_9996.N1						SS1	H/H	73	34892	269	4.07
ASA_GM1_1PNPDK20081101_154914_000001442073_00269_34892_0101.N1						SS1	H/H	73	34892	269	4.07
ASA_GM1_1PNPDK20081101_155418_000007122073_00269_34892_0103.N1						SS1	H/H	73	34892	269	4.07
ASA_GM1_1PNPDK20081101_162554_000006042073_00269_34892_0105.N1						SS1	H/H	73	34892	269	4.07
ASA_GM1_1PNPDK20081101_164134_000001992073_00269_34892_0110.N1						SS1	H/H	73	34892	269	4.07
ASA_GM1_1PNPDK20081101_170232_000004652073_00270_34893_0112.N1						SS1	H/H	73	34893	270	4.07
ASA_GM1_1PNPDK20081101_171105_000004222073_00270_34893_0119.N1						SS1	H/H	73	34893	270	4.07
ASA_GM1_1PNPDK20081101_172736_000001142073_00270_34893_0288.N1						SS1	H/H	73	34893	270	4.07
ASA_GM1_1PNPDK20081101_173442_000002892073_00270_34893_0290.N1						SS1	H/H	73	34893	270	4.07
ASA_GM1_1PNPDK20081101_180630_000007792073_00270_34893_0292.N1						SS1	H/H	73	34893	270	4.07
ASA_GM1_1PNPDK20081101_182221_000000902073_00270_34893_0297.N1						SS1	H/H	73	34893	270	4.07
ASA_GM1_1PNPDK20081101_184827_000002592073_00271_34894_0299.N1						SS1	H/H	73	34894	271	4.07


ASA_GM1_1PNPDK20081101_185404_000002292073_00271_34894_0309.N1	SS1	H/H	73	34894	271	4.07
ASA_GM1_1PNPDK20081101_190811_000004832073_00271_34894_0432.N1	SS1	H/H	73	34894	271	4.07
ASA_GM1_1PNPDK20081101_194706_000003322073_00271_34894_0434.N1	SS1	H/H	73	34894	271	4.07
ASA_GM1_1PNPDK20081101_200216_000002292073_00271_34894_0447.N1	SS1	H/H	73	34894	271	4.07
ASA_GM1_1PNPDE20081101_223149_000002112073_00273_34896_8045.N1	SS1	H/H	73	34896	273	4.07
ASA_GM1_1PNPDE20081101_230818_000001502073_00273_34896_8047.N1	SS1	H/H	73	34896	273	4.07
ASA_GM1_1PNPDE20081101_231323_000000902073_00273_34896_8049.N1	SS1	H/H	73	34896	273	4.07
ASA_GM1_1PNPDE20081101_232308_000002472073_00273_34896_8060.N1	SS1	H/H	73	34896	273	4.07


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20081101_003117_000002432073_00260_34883_6975.N1						IS2	H/H	73	34883	260	4.07
ASA_IMM_1PNPDE20081101_003117_000002502073_00260_34883_7251.N1						IS2	H/H	73	34883	260	4.07
ASA_IMM_1PNPDE20081101_003651_000000942073_00260_34883_6932.N1						IS2	H/H	73	34883	260	4.07
ASA_IMM_1PNPDE20081101_024127_000000372073_00261_34884_6963.N1						IS1	H/H	73	34884	261	4.07
ASA_IMM_1PNPDE20081101_041308_000003632073_00262_34885_7235.N1						IS2	V/V	73	34885	262	4.07
ASA_IMM_1PNPDE20081101_041308_000003782073_00262_34885_7249.N1						IS2	V/V	73	34885	262	4.07
ASA_IMM_1PNPDE20081101_045442_000001632073_00262_34885_7347.N1						IS1	H/H	73	34885	262	4.07
ASA_IMM_1PNPDK20081101_054736_000000372073_00263_34886_0218.N1						IS2	V/V	73	34886	263	4.07
ASA_IMM_1PNPDK20081101_071308_000001412073_00264_34887_9380.N1						IS2	V/V	73	34887	264	4.07
ASA_IMM_1PNPDE20081101_110339_000000962073_00266_34889_7707.N1						IS2	H/H	73	34889	266	4.07
ASA_IMM_1PNPDE20081101_114503_000000482073_00266_34889_7784.N1						IS2	V/V	73	34889	266	4.07
ASA_IMM_1PNPDK20081101_135244_000000362073_00268_34891_9921.N1						IS2	V/V	73	34891	268	4.07
ASA_IMM_1PNPDK20081101_140547_000003022073_00268_34891_9943.N1						IS2	H/H	73	34891	268	4.07
ASA_IMM_1PNPDE20081101_143127_000000772073_00268_34891_7841.N1						IS1	H/H	73	34891	268	4.07
ASA_IMM_1PNPDE20081101_151745_000000522073_00268_34891_7835.N1						IS6	V/V	73	34891	268	4.07
ASA_IMM_1PNPDE20081101_152640_000001832073_00269_34892_7875.N1						IS2	V/V	73	34892	269	4.07
ASA_IMM_1PNPDE20081101_152640_000003762073_00269_34892_7877.N1						IS2	V/V	73	34892	269	4.07
ASA_IMM_1PNPDE20081101_153042_000000602073_00269_34892_7865.N1						IS2	V/V	73	34892	269	4.07
ASA_IMM_1PNPDE20081101_153244_000000132073_00269_34892_7869.N1						IS2	***	73	34892	269	4.07
ASA_IMM_1PNPDE20081101_171015_000000382073_00270_34893_7855.N1						IS6	V/V	73	34893	270	4.07
ASA_IMM_1PNPDE20081101_172927_000000392073_00270_34893_7879.N1						IS3	H/H	73	34893	270	4.07
ASA_IMM_1PNPDE20081101_173932_000002022073_00270_34893_7919.N1						IS2	V/V	73	34893	270	4.07
ASA_IMM_1PNPDE20081101_185246_000000672073_00271_34894_7925.N1						IS1	V/V	73	34894	271	4.07
ASA_IMM_1PNPDE20081101_195237_000001792073_00271_34894_7951.N1						IS2	H/H	73	34894	271	4.07
ASA_IMM_1PNPDE20081101_195614_000001222073_00271_34894_7957.N1						IS2	H/H	73	34894	271	4.07
ASA_IMM_1PNPDE20081101_195614_000003532073_00271_34894_7959.N1						IS2	H/H	73	34894	271	4.07
ASA_IMM_1PNPDE20081101_195917_000000592073_00271_34894_7945.N1						IS2	H/H	73	34894	271	4.07
ASA_IMM_1PNPDE20081101_200117_000000502073_00271_34894_7949.N1						IS2	H/H	73	34894	271	4.07
ASA_IMM_1PNPDE20081101_231050_000001412073_00273_34896_8142.N1						IS2	H/H	73	34896	273	4.07
ASA_IMM_1PNPDE20081101_231450_000004882073_00273_34896_8162.N1						IS2	H/H	73	34896	273	4.07


Filename	Pol	Timestamp	count(Module)
ASA_MS__0PNPDE20081101_030234_000000162073_00261_34884_0349.N1	H	2008-11-01 03:02:34	320
ASA_MS__0PNPDE20081101_222916_000000162073_00273_34896_0350.N1	H	2008-11-01 22:29:16	320


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WSM_1PNPDE20081101_003904_000002142073_00260_34883_7452.N1						SS1	H/H	73	34883	260	4.07
ASA_WSM_1PNPDE20081101_004018_000001392073_00260_34883_6977.N1						SS1	H/H	73	34883	260	4.07
ASA_WSM_1PNPDE20081101_012743_000003732073_00260_34883_6969.N1						SS1	H/H	73	34883	260	4.07
ASA_WSM_1PNPDE20081101_021317_000001352073_00261_34884_7090.N1						SS1	H/H	73	34884	261	4.07
ASA_WSM_1PNPDE20081101_021317_000003122073_00261_34884_7472.N1						SS1	H/H	73	34884	261	4.07
ASA_WSM_1PNPDE20081101_021627_000001212073_00261_34884_7091.N1						SS1	H/H	73	34884	261	4.07
ASA_WSM_1PNPDE20081101_023907_000000912073_00261_34884_6984.N1						SS1	V/V	73	34884	261	4.07
ASA_WSM_1PNPDE20081101_024212_000000922073_00261_34884_7055.N1						SS1	V/V	73	34884	261	4.07
ASA_WSM_1PNPDE20081101_030450_000003482073_00261_34884_7146.N1						SS1	H/H	73	34884	261	4.07
ASA_WSM_1PNPDE20081101_031111_000000922073_00261_34884_7228.N1						SS1	H/H	73	34884	261	4.07
ASA_WSM_1PNPDE20081101_034034_000001532073_00262_34885_7233.N1						SS1	V/V	73	34885	262	4.07
ASA_WSM_1PNPDE20081101_034348_000001352073_00262_34885_7319.N1						SS1	H/H	73	34885	262	4.07
ASA_WSM_1PNPDE20081101_034348_000003542073_00262_34885_7474.N1						SS1	H/H	73	34885	262	4.07
ASA_WSM_1PNPDE20081101_034658_000001632073_00262_34885_7320.N1						SS1	H/H	73	34885	262	4.07
ASA_WSM_1PNPDE20081101_044926_000001352073_00262_34885_7464.N1						SS1	H/H	73	34885	262	4.07
ASA_WSM_1PNPDE20081101_044926_000002932073_00262_34885_7505.N1						SS1	H/H	73	34885	262	4.07
ASA_WSM_1PNPDE20081101_045337_000000422073_00262_34885_7345.N1						SS1	H/H	73	34885	262	4.07
ASA_WSM_1PNPDE20081101_045747_000001652073_00262_34885_7450.N1						SS1	H/H	73	34885	262	4.07
ASA_WSM_1PNPDE20081101_053310_000000732073_00263_34886_7329.N1						SS1	H/H	73	34886	263	4.07
ASA_WSM_1PNPDE20081101_062202_000002692073_00263_34886_7480.N1						SS1	H/H	73	34886	263	4.07
ASA_WSM_1PNPDE20081101_074908_000002502073_00264_34887_7553.N1						SS1	H/H	73	34887	264	4.07
ASA_WSM_1PNPDE20081101_075509_000001902073_00264_34887_7545.N1						SS1	V/V	73	34887	264	4.07
ASA_WSM_1PNPDE20081101_091432_000000912073_00265_34888_7590.N1						SS1	V/V	73	34888	265	4.07
ASA_WSM_1PNPDE20081101_092510_000001532073_00265_34888_7655.N1						SS1	H/H	73	34888	265	4.07
ASA_WSM_1PNPDE20081101_094315_000003732073_00265_34888_7778.N1						SS1	H/H	73	34888	265	4.07
ASA_WSM_1PNPDE20081101_094315_000005082073_00265_34888_7797.N1						SS1	H/H	73	34888	265	4.07
ASA_WSM_1PNPDE20081101_095113_000001152073_00265_34888_7679.N1						SS1	H/H	73	34888	265	4.07
ASA_WSM_1PNPDE20081101_095125_00000182073_00265_34888_7766.N1						SS1	H/H	73	34888	265	4.07
ASA_WSM_1PNPDE20081101_095336_000001472073_00265_34888_7748.N1						SS1	H/H	73	34888	265	4.07
ASA_WSM_1PNPDE20081101_112551_000002082073_00266_34889_7772.N1						SS1	H/H	73	34889	266	4.07
ASA_WSM_1PNPDE20081101_113313_000003912073_00266_34889_7815.N1						SS1	H/H	73	34889	266	4.07
ASA_WSM_1PNPDE20081101_115531_000002072073_00266_34889_7813.N1						SS1	V/V	73	34889	266	4.07
ASA_WSM_1PNPDE20081101_121807_000001092073_00267_34890_7776.N1						SS1	H/H	73	34890	267	4.07
ASA_WSM_1PNPDE20081101_124938_000000922073_00267_34890_7787.N1						SS1	H/H	73	34890	267	4.07
ASA_WSM_1PNPDE20081101_144503_000000912073_00268_34891_7871.N1						SS1	H/H	73	34891	268	4.07
ASA_WSM_1PNPDE20081101_153620_000000612073_00269_34892_7817.N1						SS1	H/H	73	34892	269	4.07
ASA_WSM_1PNPDE20081101_163600_000003302073_00269_34892_7873.N1						SS1	H/H	73	34892	269	4.07
ASA_WSM_1PNPDE20081101_173019_000002502073_00270_34893_7921.N1						SS1	H/H	73	34893	270	4.07
ASA_WSM_1PNPDE20081101_181931_000001652073_00270_34893_7917.N1						SS1	H/H	73	34893	270	4.07
ASA_WSM_1PNPDE20081101_184443_000000912073_00271_34894_7955.N1						SS1	V/V	73	34894	271	4.07
ASA_WSM_1PNPDE20081101_184550_000000732073_00271_34894_7903.N1						SS1	V/V	73	34894	271	4.07
ASA_WSM_1PNPDE20081101_184550_000001532073_00271_34894_7953.N1						SS1	V/V	73	34894	271	4.07
ASA_WSM_1PNPDE20081101_184805_000000182073_00271_34894_7907.N1						SS1	V/V	73	34894	271	4.07
ASA_WSM_1PNPDE20081101_190634_000000922073_00271_34894_7923.N1						SS1	H/H	73	34894	271	4.07
ASA_WSM_1PNPDE20081101_235904_000002262073_00274_34897_8323.N1						SS1	H/H	73	34897	274	4.07




Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20081031_235858_000003002073_00259_34882_6711.N1						IS2	V/V	73	34882	259	4.07
ASA_WVS_1PNPDE20081101_000258_000016492073_00259_34882_6834.N1						IS2	V/V	73	34882	259	4.07
ASA_WVS_1PNPDE20081101_005149_000009752073_00260_34883_6839.N1						IS2	V/V	73	34883	260	4.07
ASA_WVS_1PNPDE20081101_011502_000002852073_00260_34883_6849.N1						IS2	V/V	73	34883	260	4.07
ASA_WVS_1PNPDE20081101_013934_000001192073_00260_34883_6842.N1						IS2	V/V	73	34883	260	4.07
ASA_WVS_1PNPDE20081101_014034_000003302073_00260_34883_6980.N1						IS2	V/V	73	34883	260	4.07
ASA_WVS_1PNPDE20081101_013934_000001192073_00260_34883_6842.N1						IS1	V/V	73	34883	260	4.07
ASA_WVS_1PNPDE20081101_015717_000002092073_00261_34884_6987.N1						IS2	V/V	73	34884	261	4.07
ASA_WVS_1PNPDE20081101_024343_000010042073_00261_34884_6992.N1						IS2	V/V	73	34884	261	4.07
ASA_WVS_1PNPDE20081101_030013_000000152073_00261_34884_7102.N1						IS2	V/V	73	34884	261	4.07
ASA_WVS_1PNPDE20081101_032010_000000452073_00261_34884_7097.N1						IS2	V/V	73	34884	261	4.07
ASA_WVS_1PNPDE20081101_032744_000001492073_00261_34884_7111.N1						IS2	V/V	73	34884	261	4.07
ASA_WVS_1PNPDE20081101_033603_000000892073_00262_34885_7134.N1						IS2	V/V	73	34885	262	4.07
ASA_WVS_1PNPDE20081101_042151_000008992073_00262_34885_7141.N1						IS2	V/V	73	34885	262	4.07
ASA_WVS_1PNPDE20081101_043621_000001352073_00262_34885_7350.N1						IS2	V/V	73	34885	262	4.07
ASA_WVS_1PNPDE20081101_042151_000008992073_00262_34885_7141.N1						IS1	V/V	73	34885	262	4.07
ASA_WVS_1PNPDE20081101_050037_000013192073_00262_34885_7388.N1						IS2	V/V	73	34885	262	4.07
ASA_WVS_1PNPDE20081101_060141_000009742073_00263_34886_7393.N1						IS2	V/V	73	34886	263	4.07
ASA_WVS_1PNPDK20081101_061741_000002252073_00263_34886_9287.N1						IS2	V/V	73	34886	263	4.07
ASA_WVS_1PNPDK20081101_064122_000018742073_00263_34886_9322.N1						IS2	V/V	73	34886	263	4.07
ASA_WVS_1PNPDK20081101_075936_000001352073_00264_34887_9398.N1						IS2	V/V	73	34887	264	4.07
ASA_WVS_1PNPDK20081101_082158_000019792073_00264_34887_9407.N1						IS2	V/V	73	34887	264	4.07
ASA_WVS_1PNPDK20081101_092741_000008842073_00265_34888_9539.N1						IS2	V/V	73	34888	265	4.07
ASA_WVS_1PNPDK20081101_100233_000018292073_00265_34888_9544.N1						IS2	V/V	73	34888	265	4.07
ASA_WVS_1PNPDK20081101_105138_000000602073_00266_34889_9670.N1						IS2	V/V	73	34889	266	4.07
ASA_WVS_1PNPDK20081101_105814_000001192073_00266_34889_9675.N1						IS2	V/V	73	34889	266	4.07
ASA_WVS_1PNPDK20081101_110521_000010792073_00266_34889_9684.N1						IS2	V/V	73	34889	266	4.07
ASA_WVS_1PNPDK20081101_114309_000000752073_00266_34889_9687.N1						IS2	V/V	73	34889	266	4.07
ASA_WVS_1PNPDK20081101_114558_000005242073_00266_34889_9692.N1						IS2	V/V	73	34889	266	4.07
ASA_WVS_1PNPDK20081101_115901_000007642073_00267_34890_9704.N1						IS2	V/V	73	34890	267	4.07
ASA_WVS_1PNPDK20081101_123214_000009892073_00267_34890_9817.N1						IS2	V/V	73	34890	267	4.07
ASA_WVS_1PNPDK20081101_130027_000002102073_00267_34890_9822.N1						IS2	V/V	73	34890	267	4.07
ASA_WVS_1PNPDK20081101_132345_000002102073_00267_34890_9827.N1						IS2	V/V	73	34890	267	4.07
ASA_WVS_1PNPDK20081101_133549_000005242073_00267_34890_9830.N1						IS2	V/V	73	34890	267	4.07
ASA_WVS_1PNPDK20081101_134539_000000442073_00268_34891_9842.N1						IS2	V/V	73	34891	268	4.07
ASA_WVS_1PNPDK20081101_141544_000001052073_00268_34891_9970.N1						IS2	V/V	73	34891	268	4.07
ASA_WVS_1PNPDK20081101_143429_000005852073_00268_34891_9975.N1						IS2	V/V	73	34891	268	4.07
ASA_WVS_1PNPDK20081101_150421_000007642073_00268_34891_9978.N1						IS2	V/V	73	34891	268	4.07
ASA_WVS_1PNPDK20081101_151843_000001942073_00268_34891_9989.N1						IS2	V/V	73	34891	268	4.07
ASA_WVS_1PNPDK20081101_160614_000011392073_00269_34892_0108.N1						IS2	V/V	73	34892	269	4.07
ASA_WVS_1PNPDK20081101_164457_000010042073_00269_34892_0122.N1						IS2	V/V	73	34892	269	4.07
ASA_WVS_1PNPDK20081101_174301_000013642073_00270_34893_0295.N1						IS2	V/V	73	34893	270	4.07
ASA_WVS_1PNPDK20081101_182822_000009442073_00270_34893_0307.N1						IS2	V/V	73	34893	270	4.07
ASA_WVS_1PNPDK20081101_191616_000017992073_00271_34894_0437.N1						IS2	V/V	73	34894	271	4.07
ASA_WVS_1PNPDK20081101_200609_000004502073_00271_34894_0445.N1						IS2	V/V	73	34894	271	4.07
ASA_WVS_1PNPDE20081101_223523_000019342073_00273_34896_8058.N1						IS2	V/V	73	34896	273	4.07
ASA_WVS_1PNPDE20081101_232721_000001652073_00273_34896_8063.N1						IS2	V/V	73	34896	273	4.07
ASA_WVS_1PNPDE20081101_232921_000017392073_00273_34896_8189.N1						IS2	V/V	73	34896	273	4.07



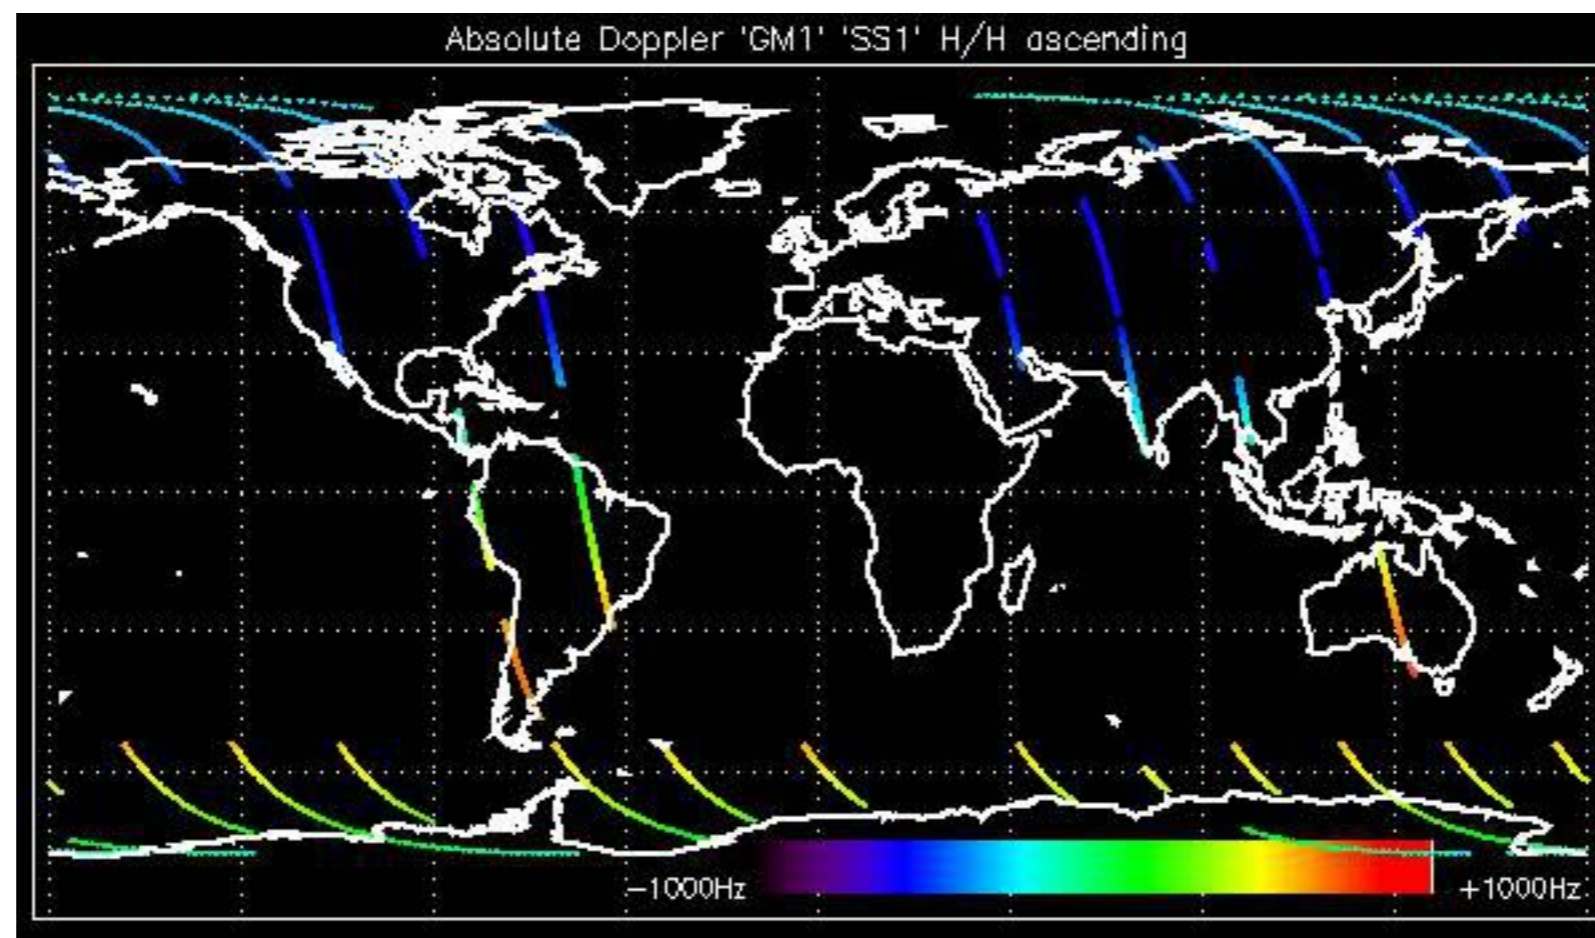


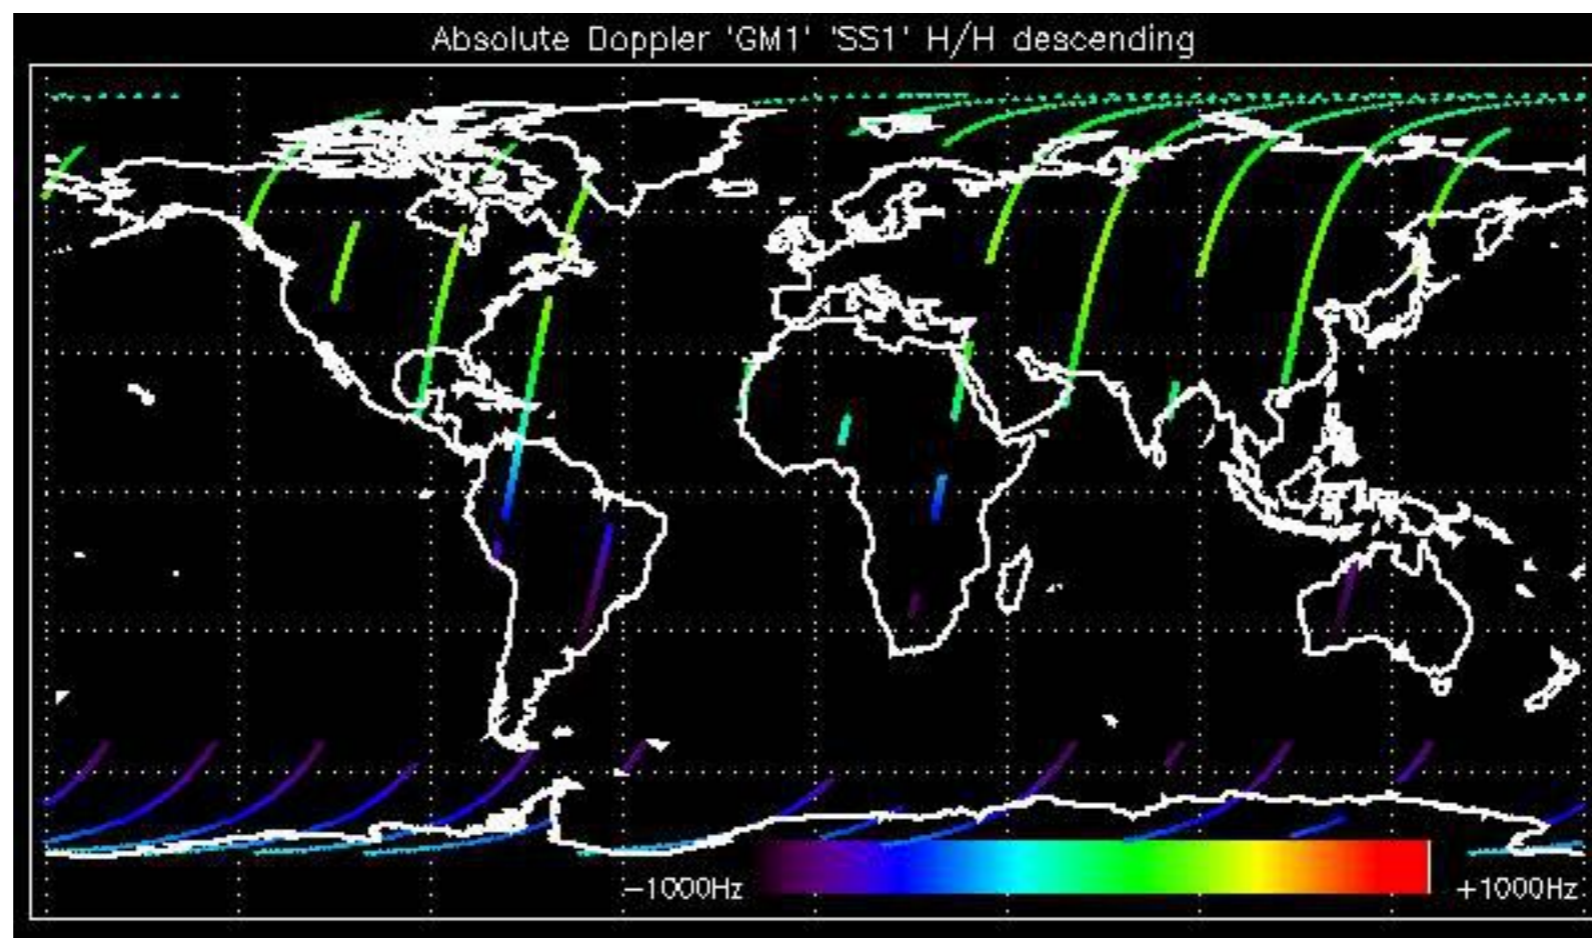


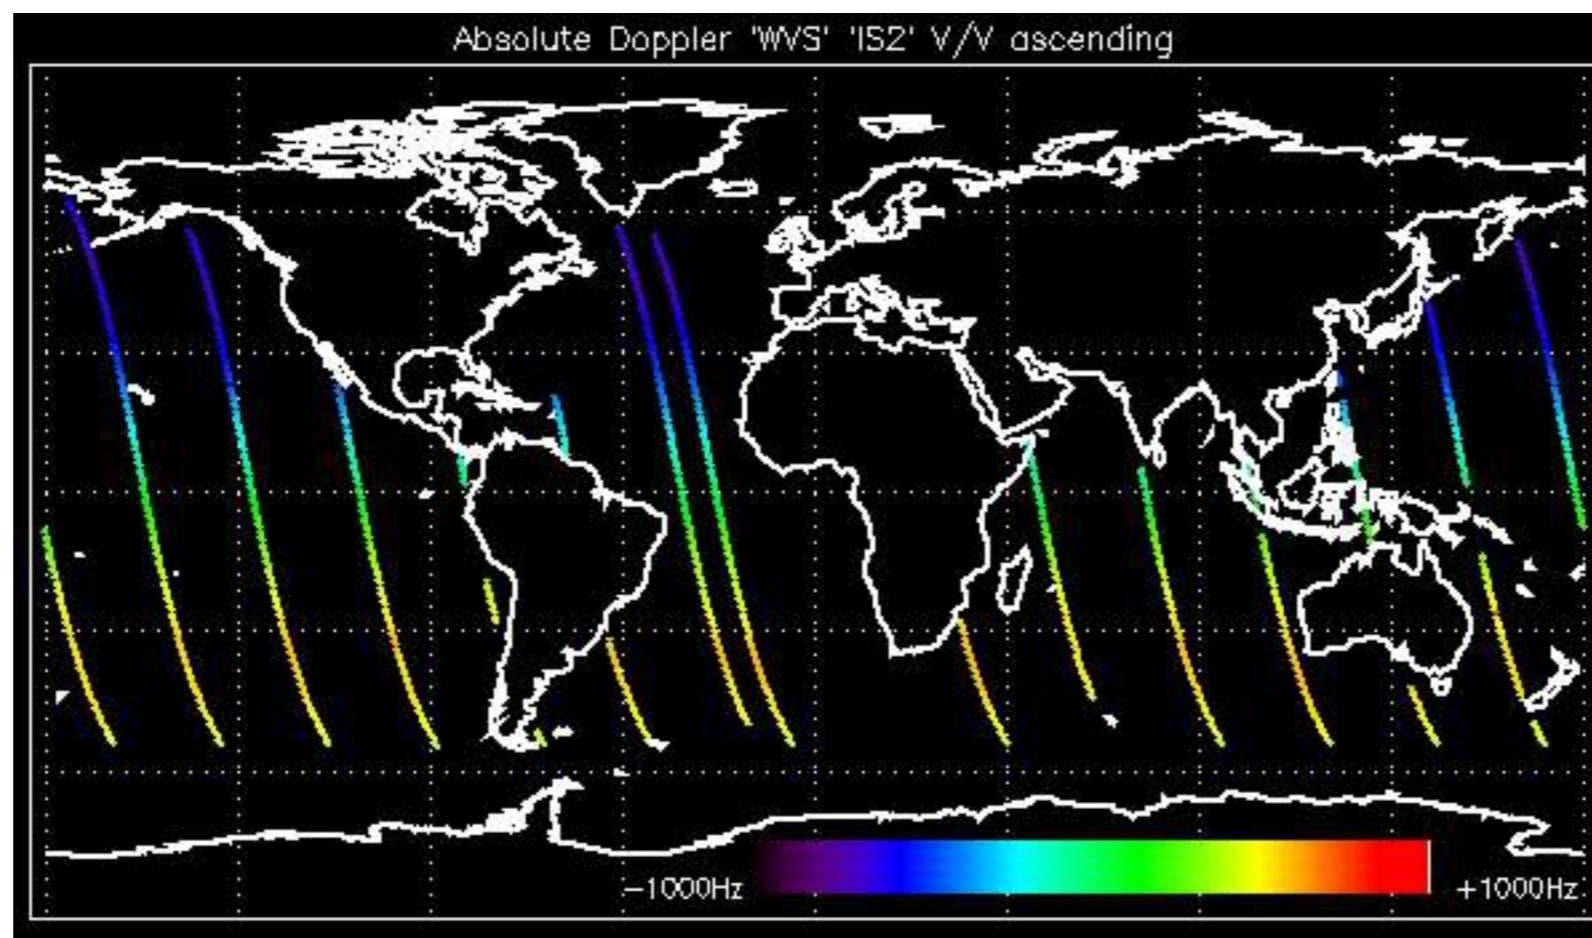


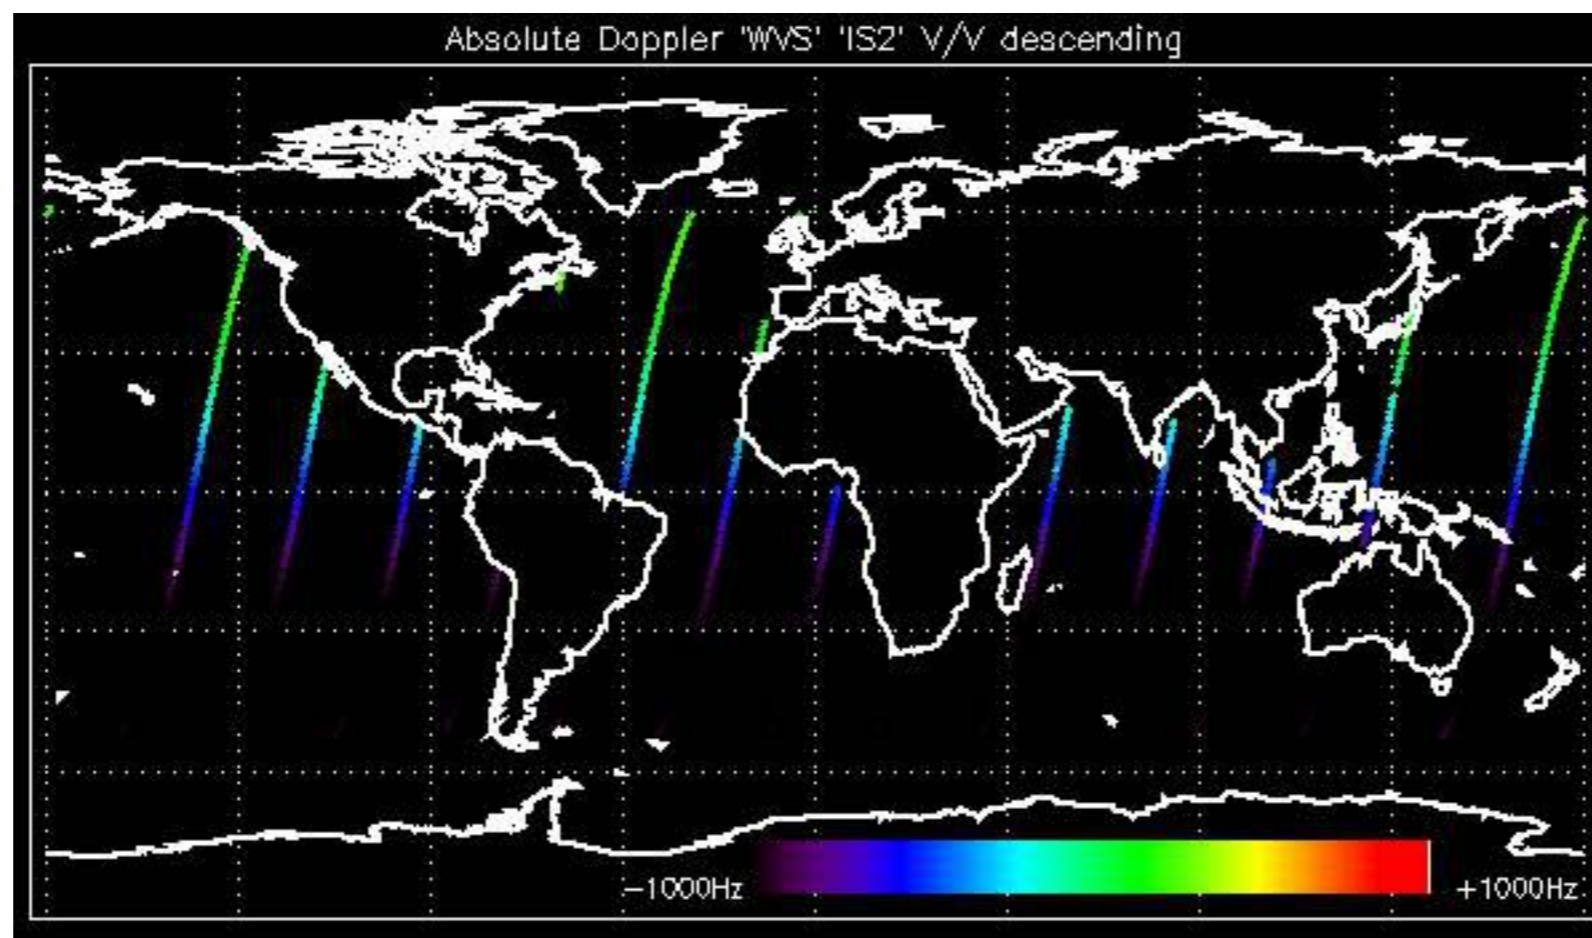


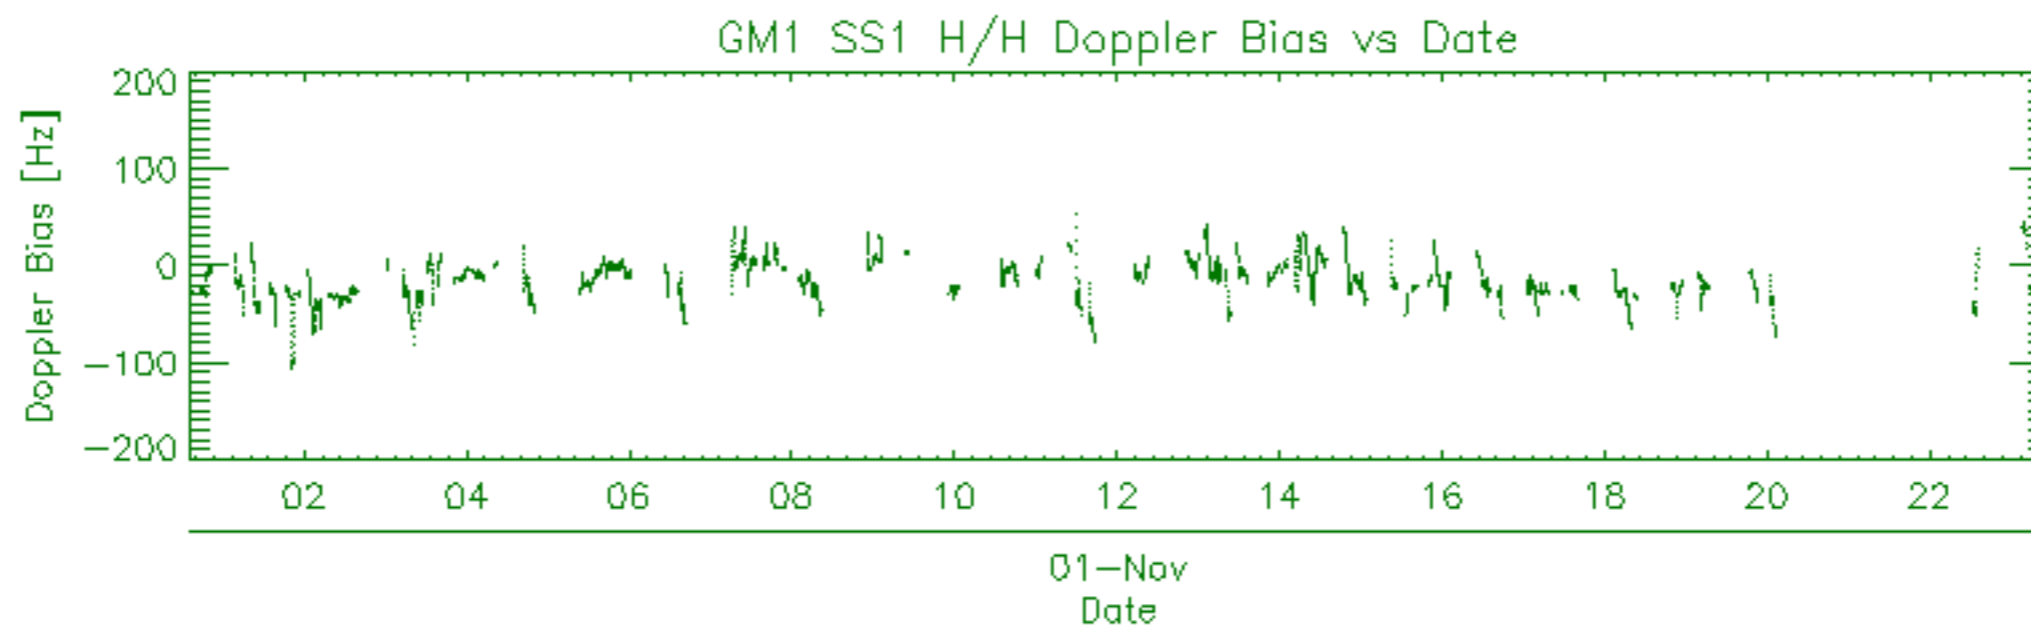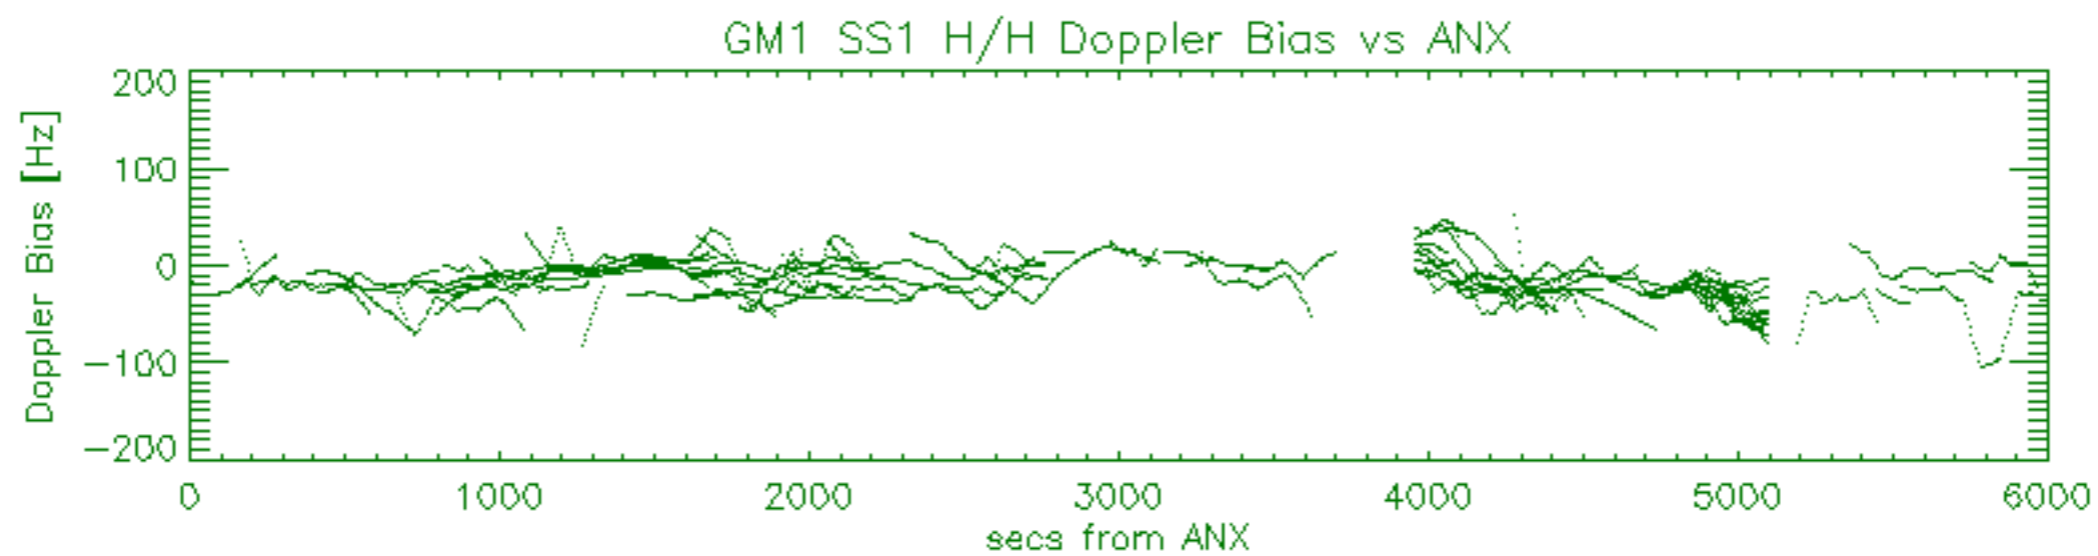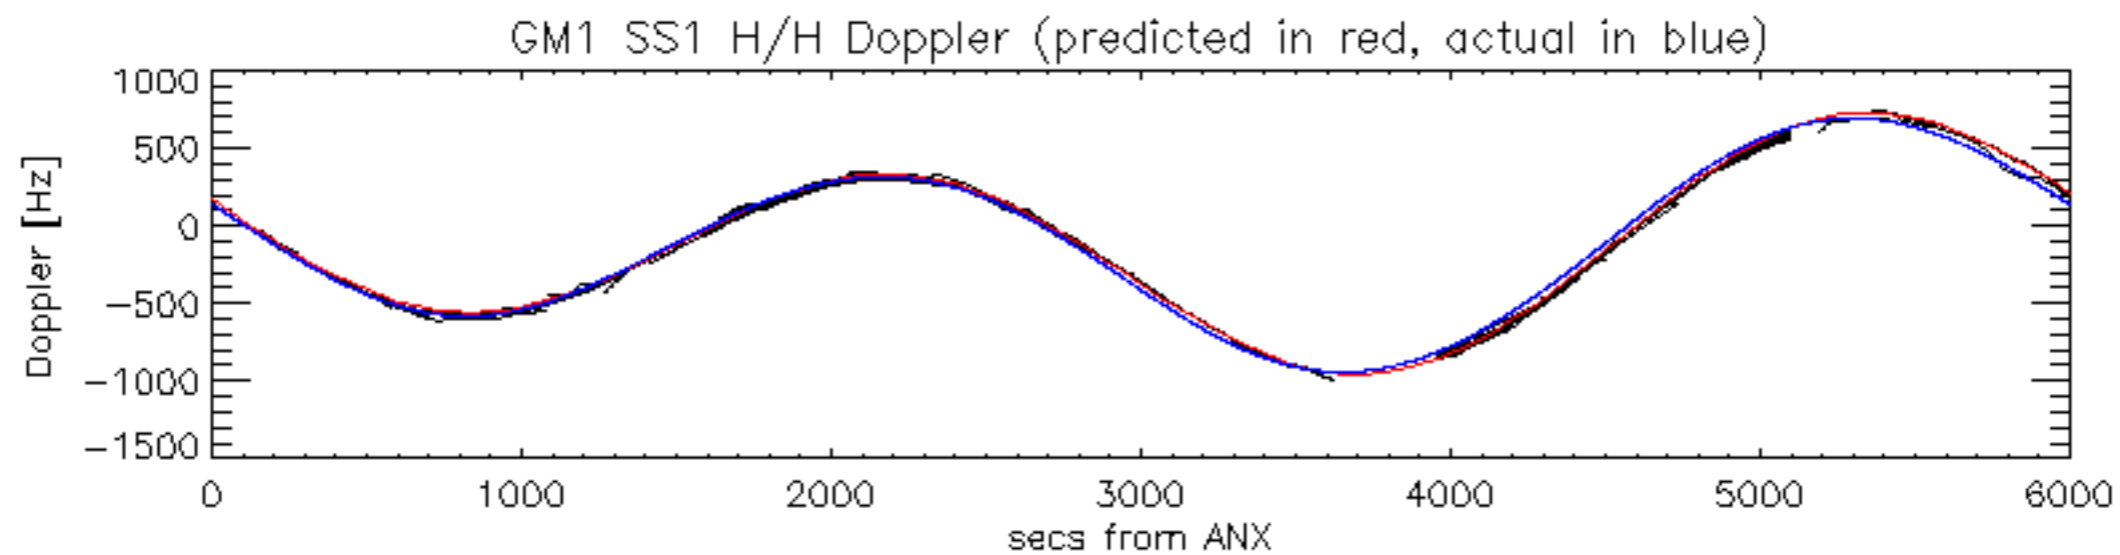



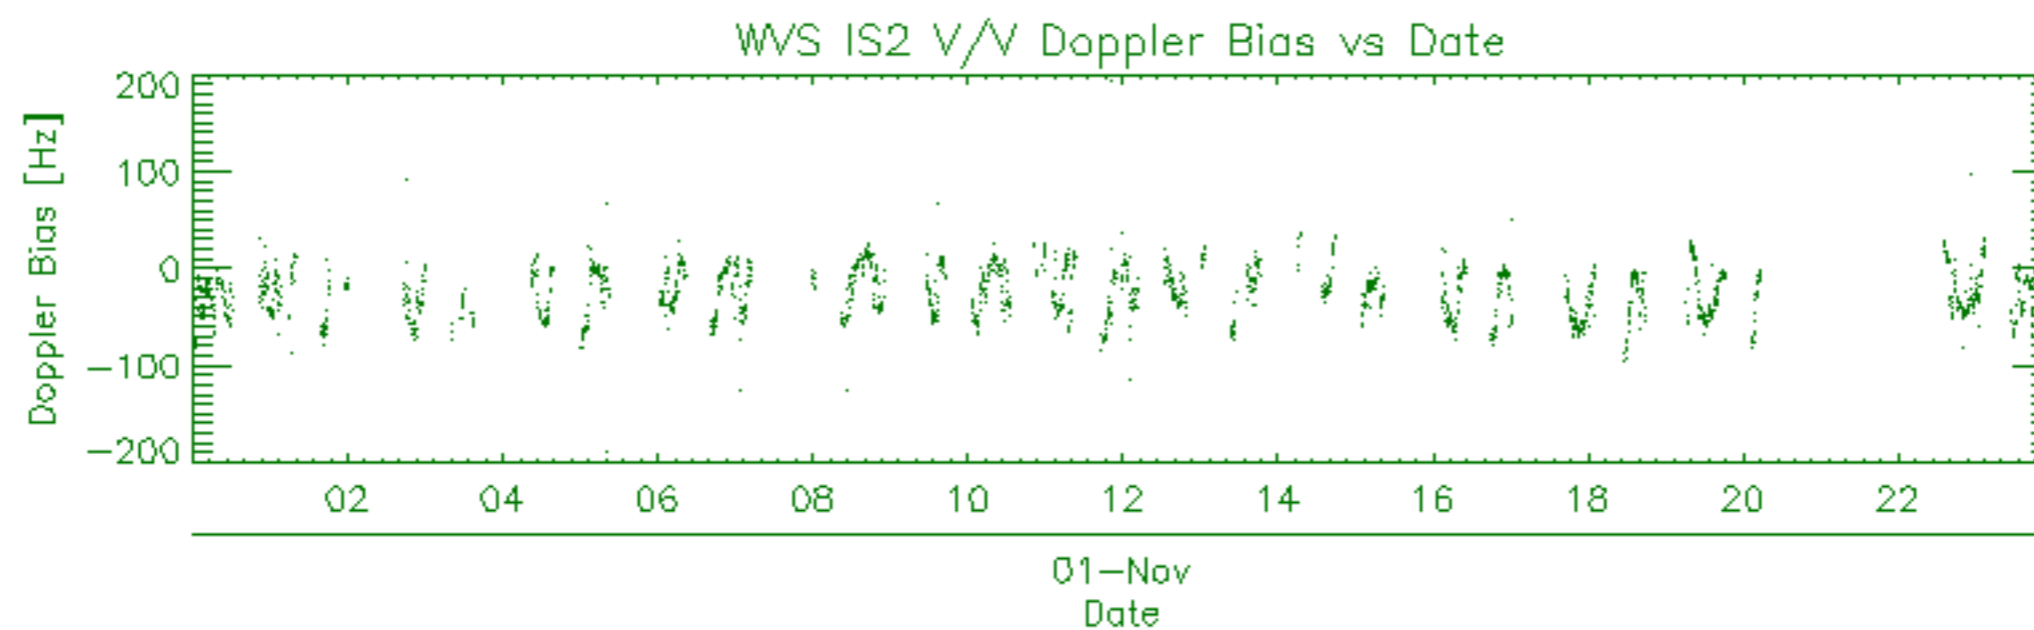
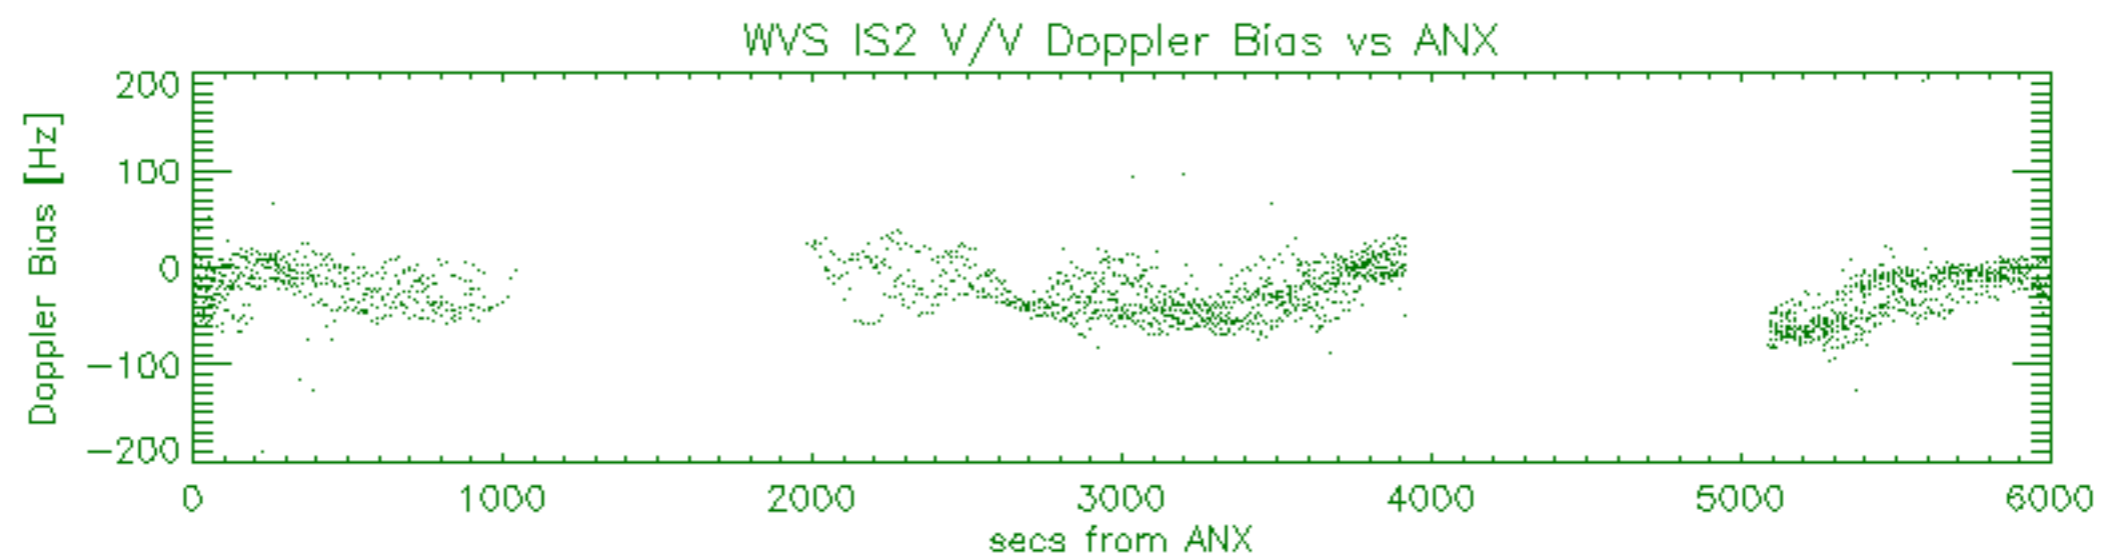
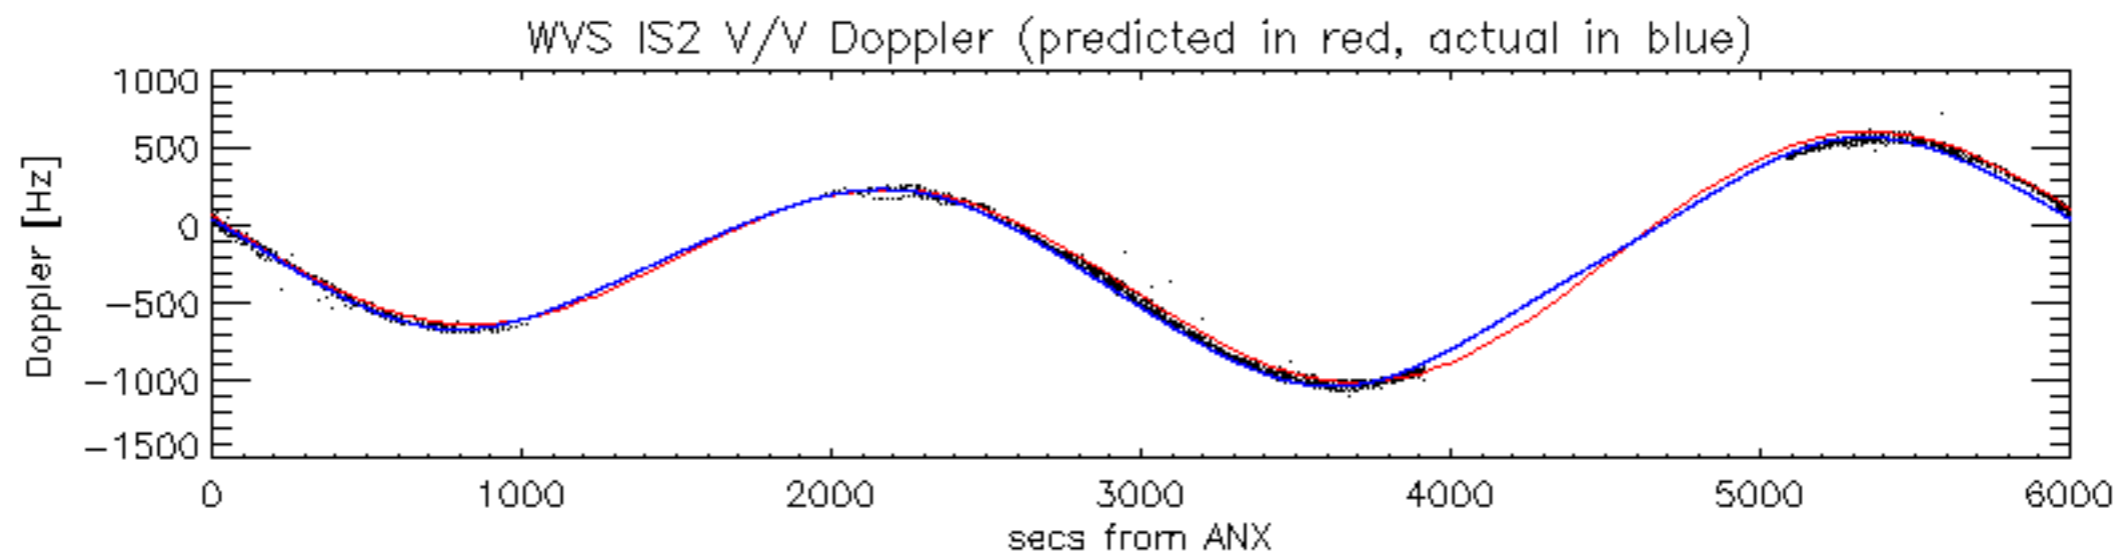


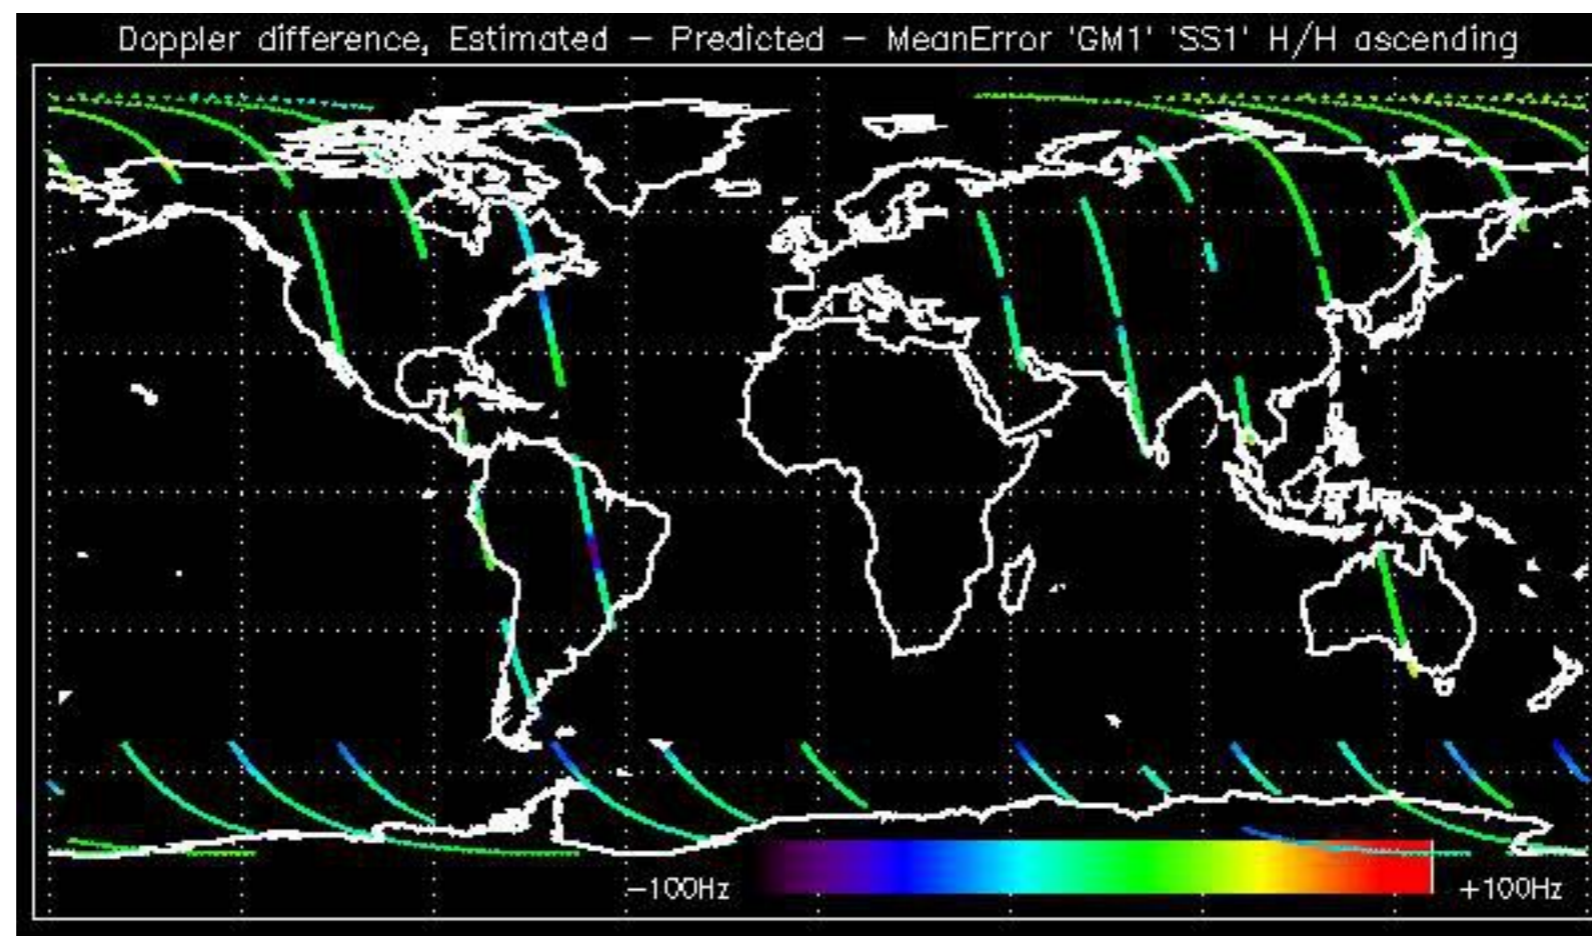


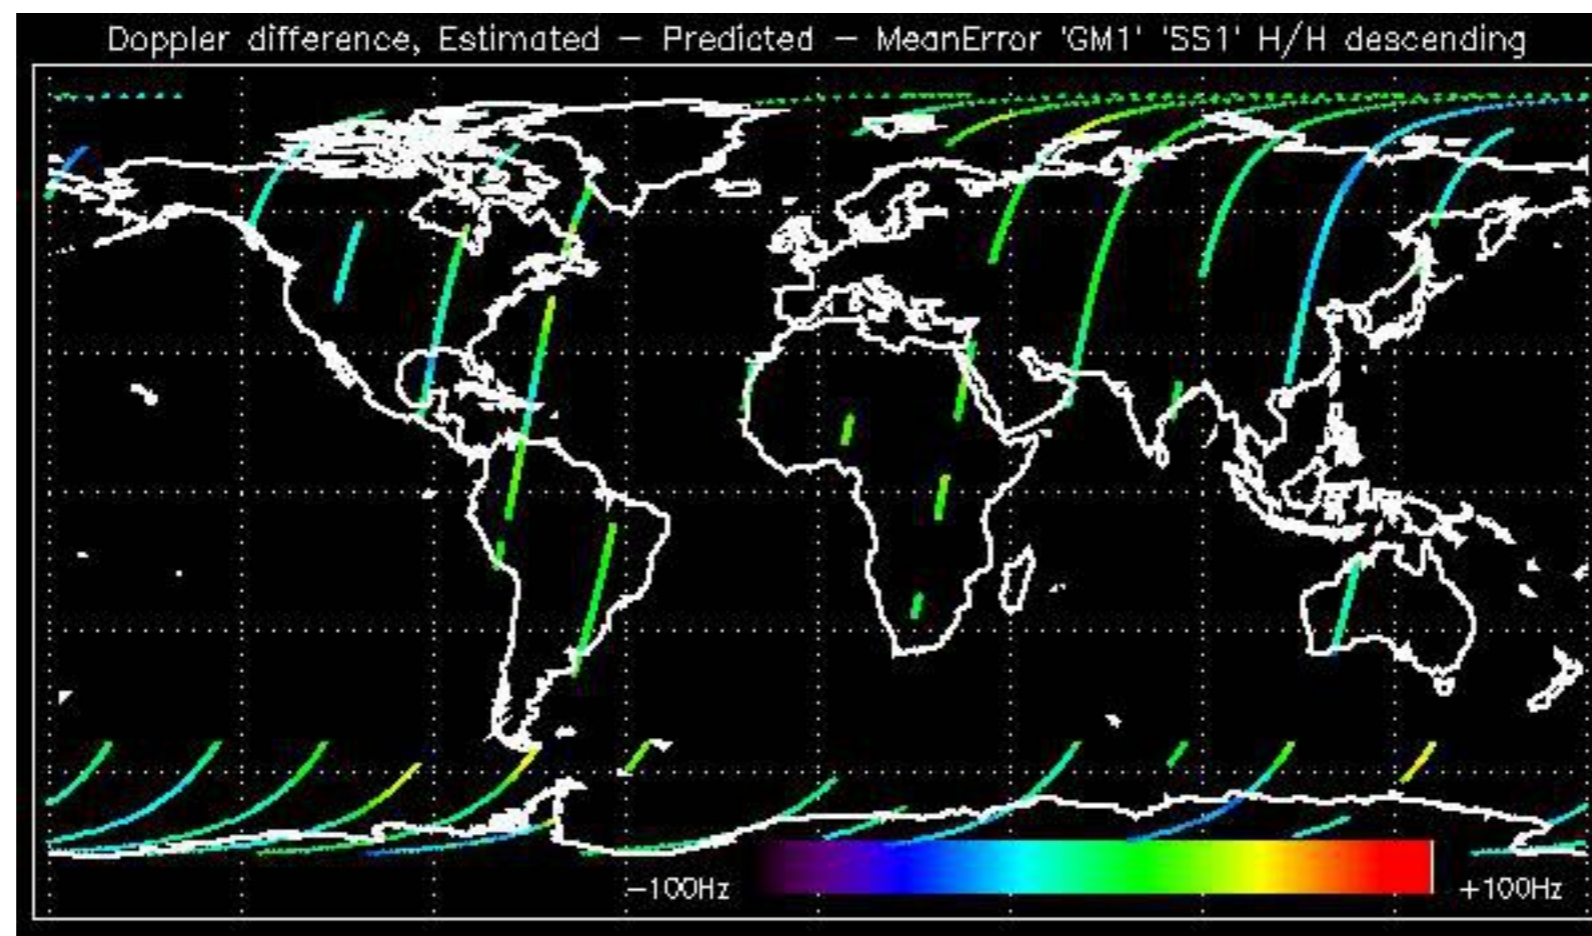




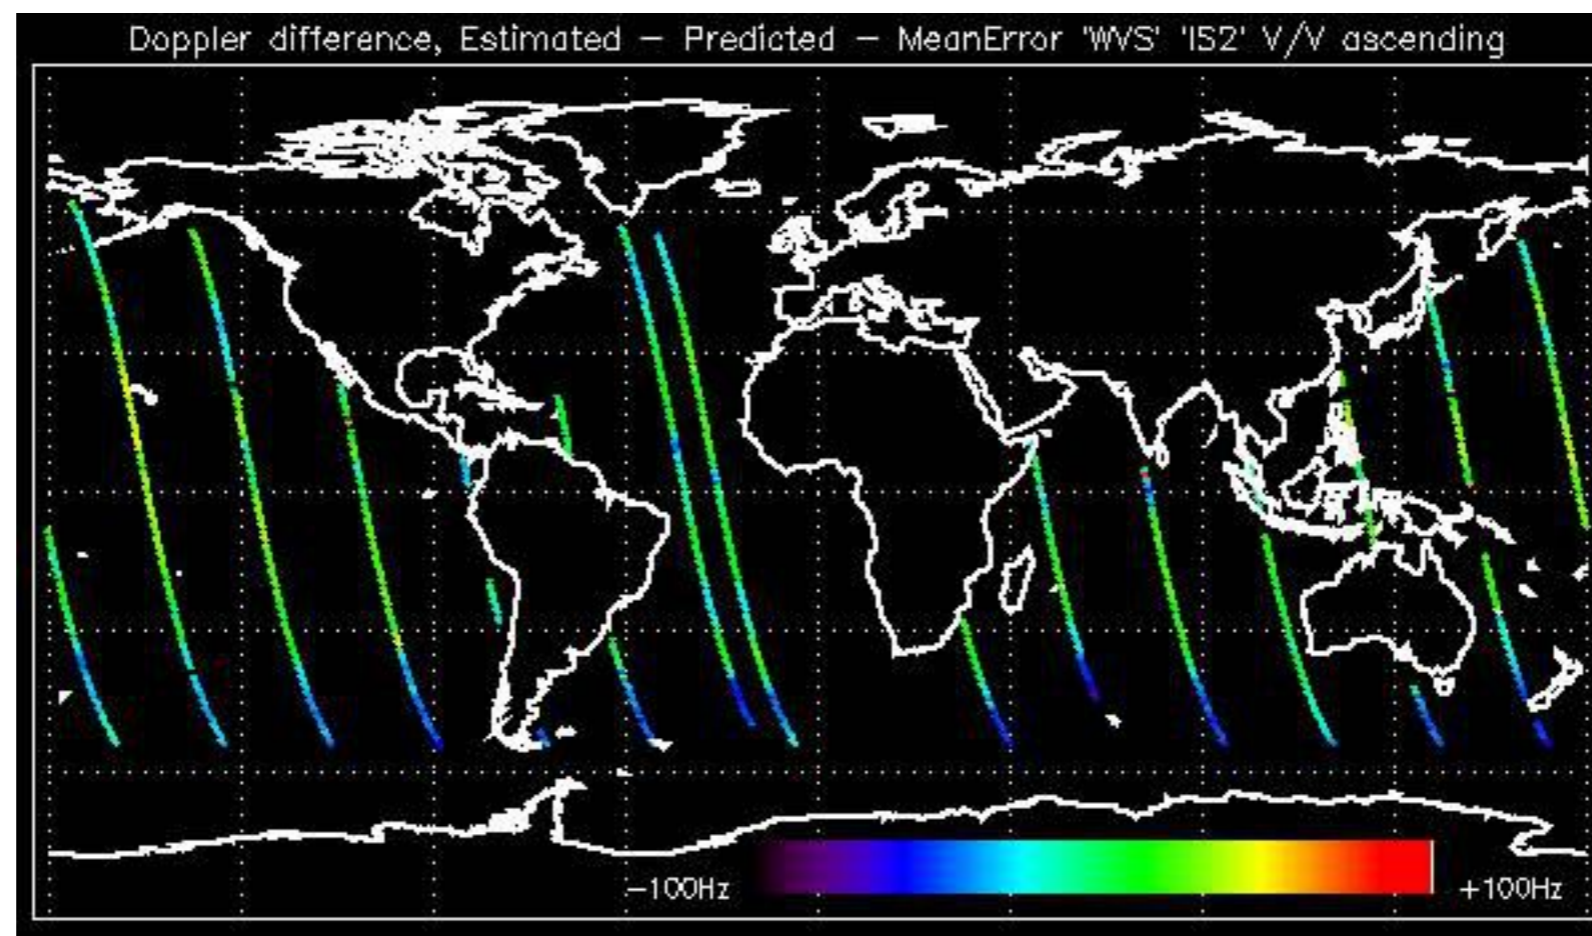




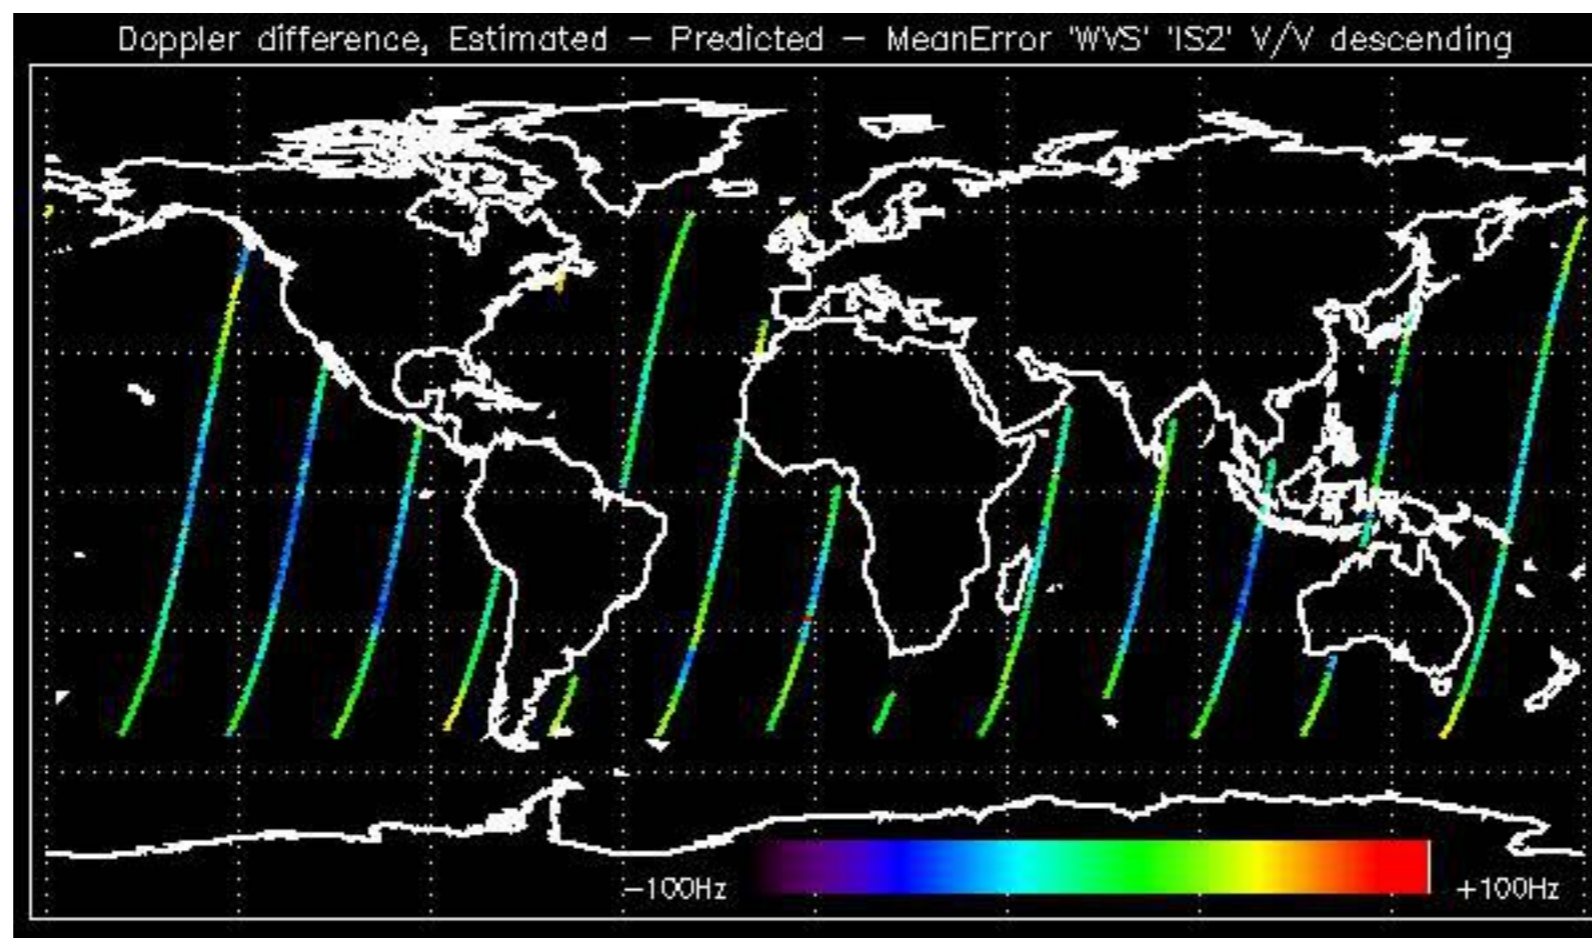


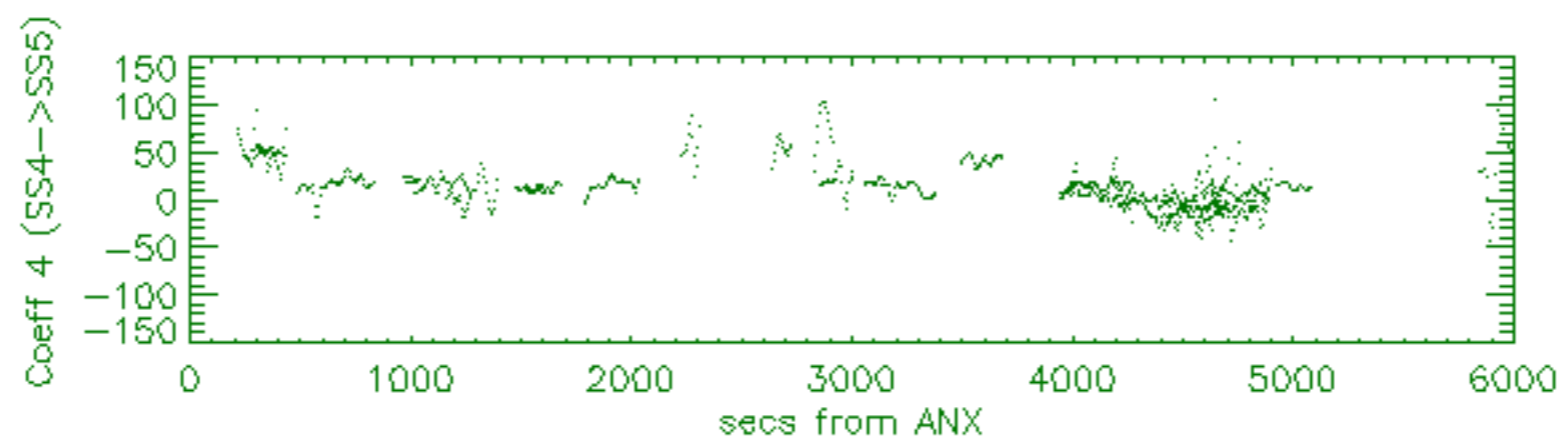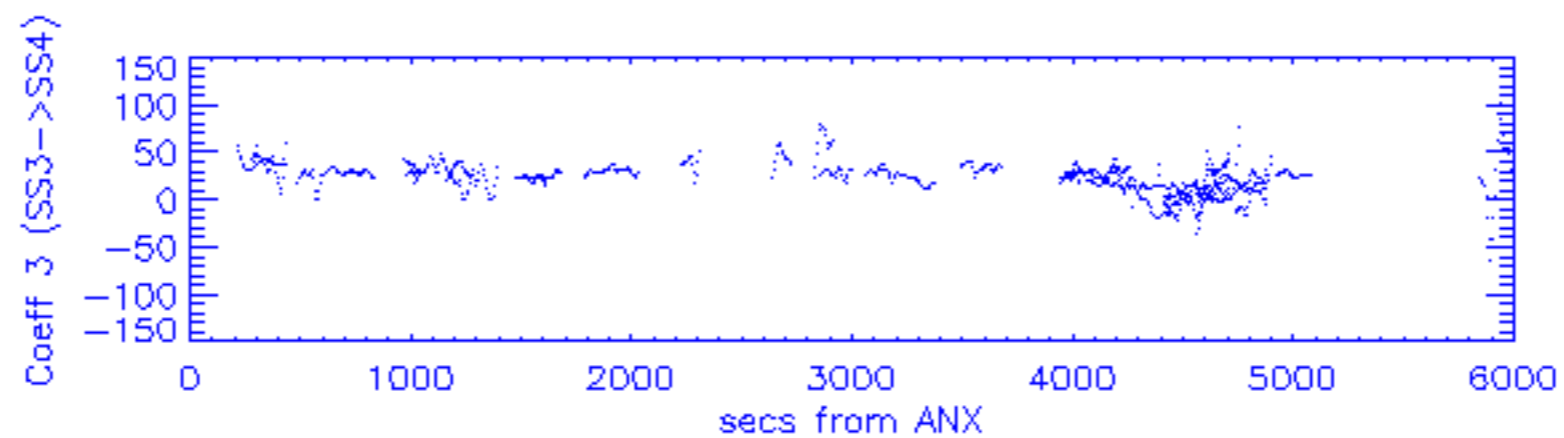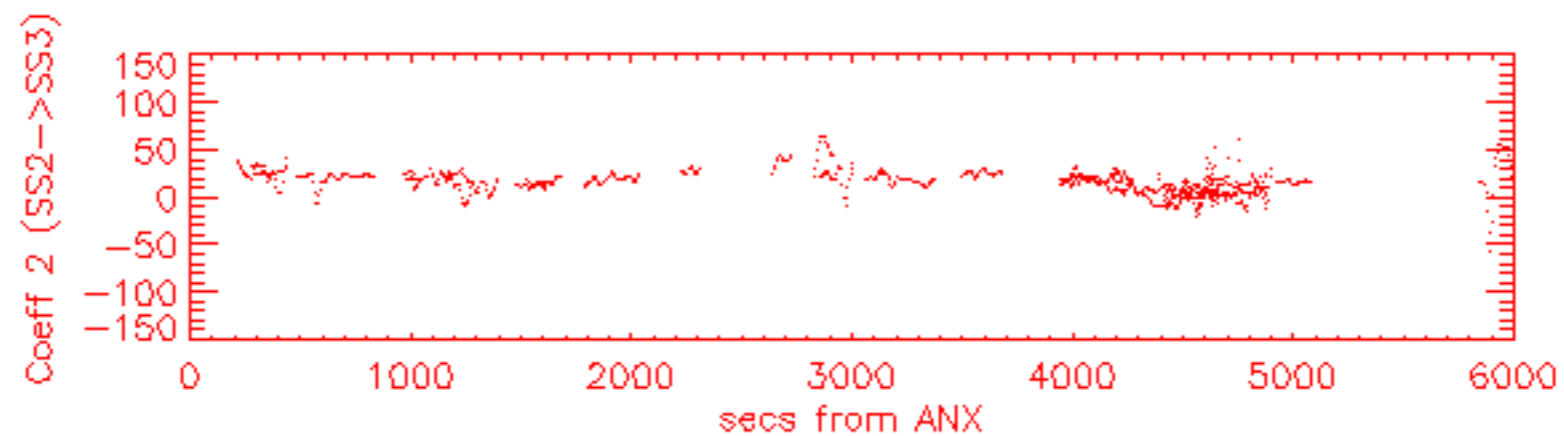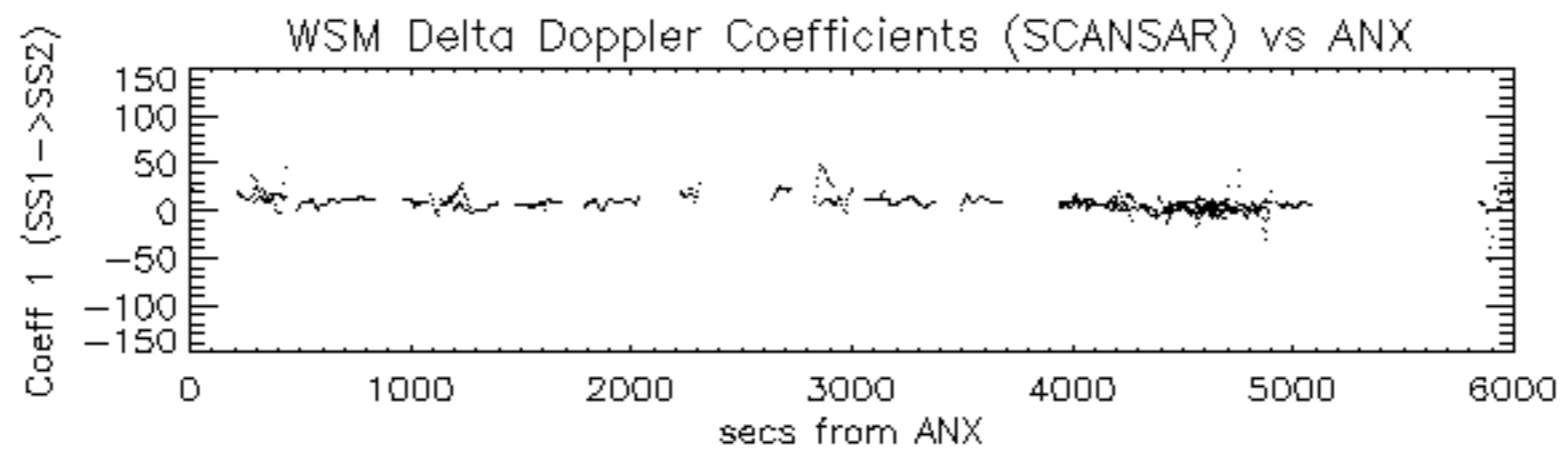




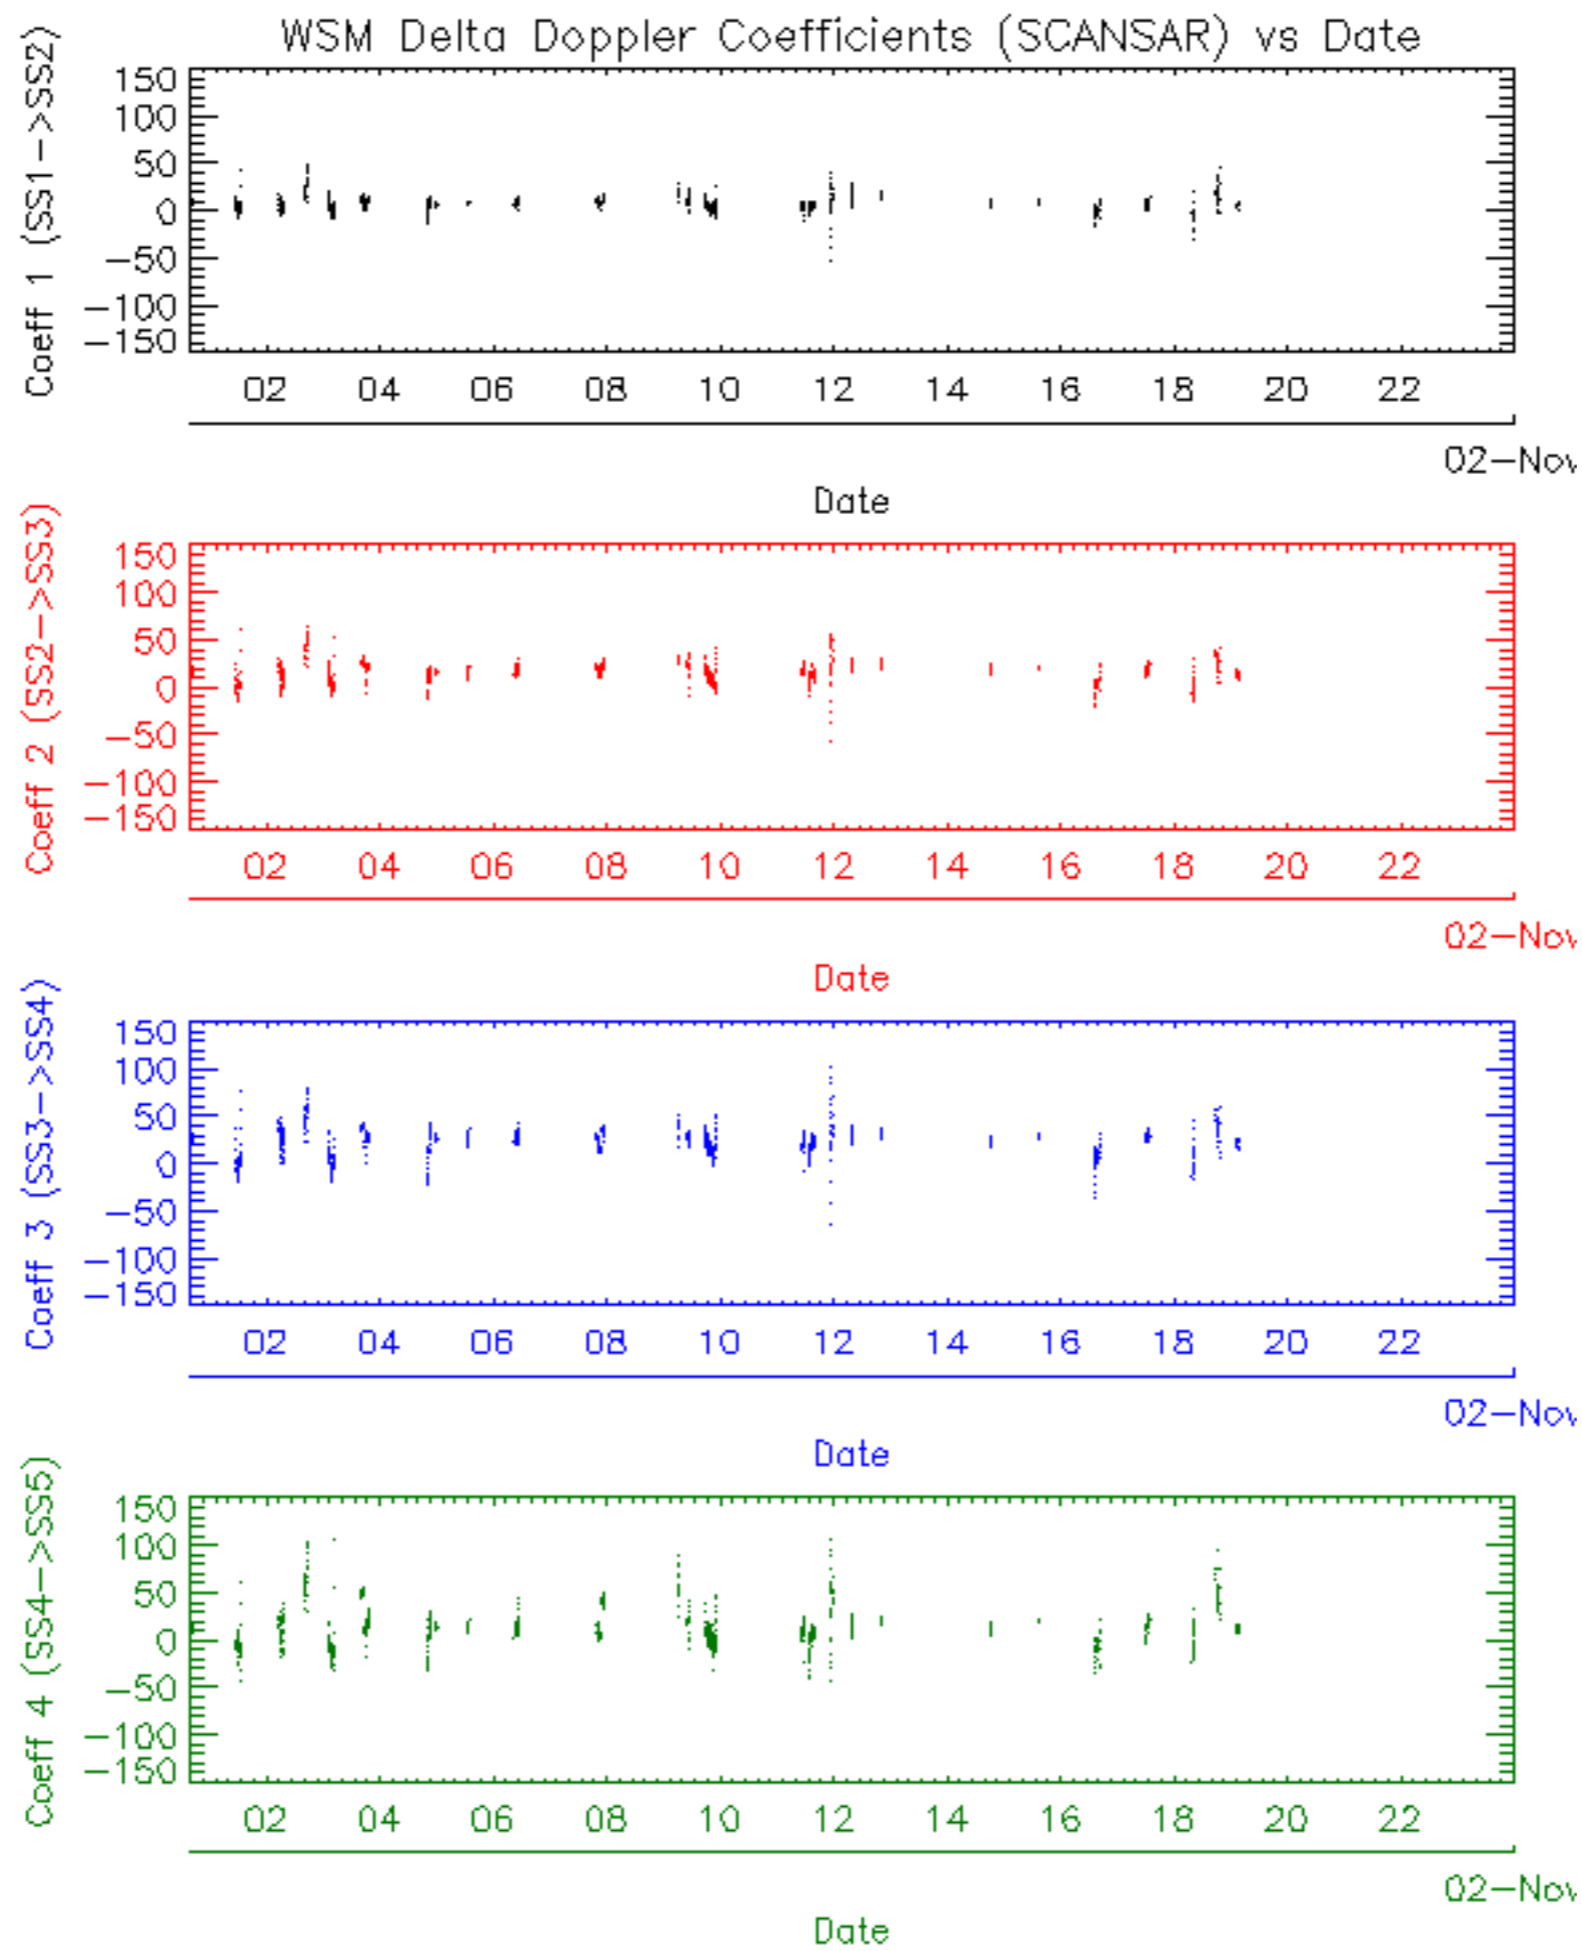


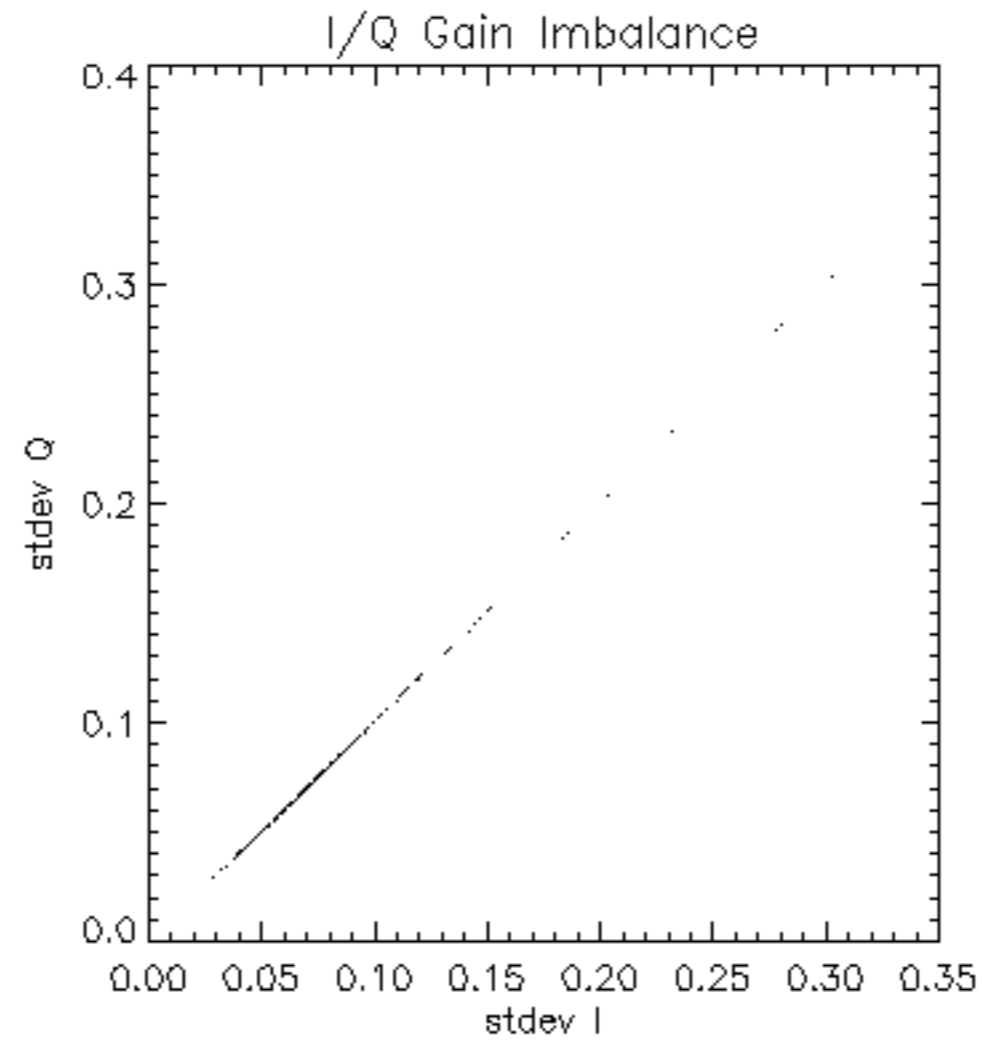


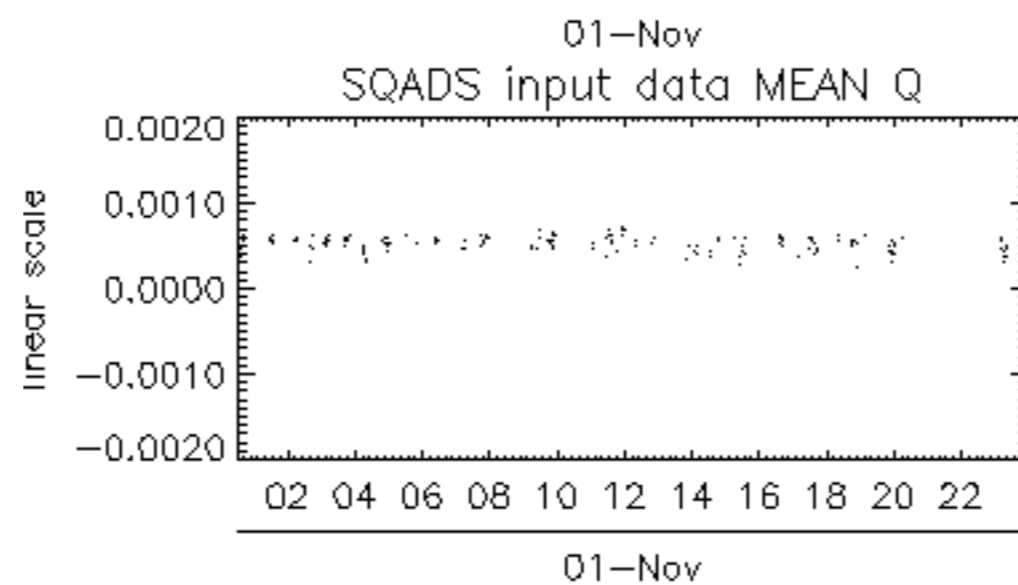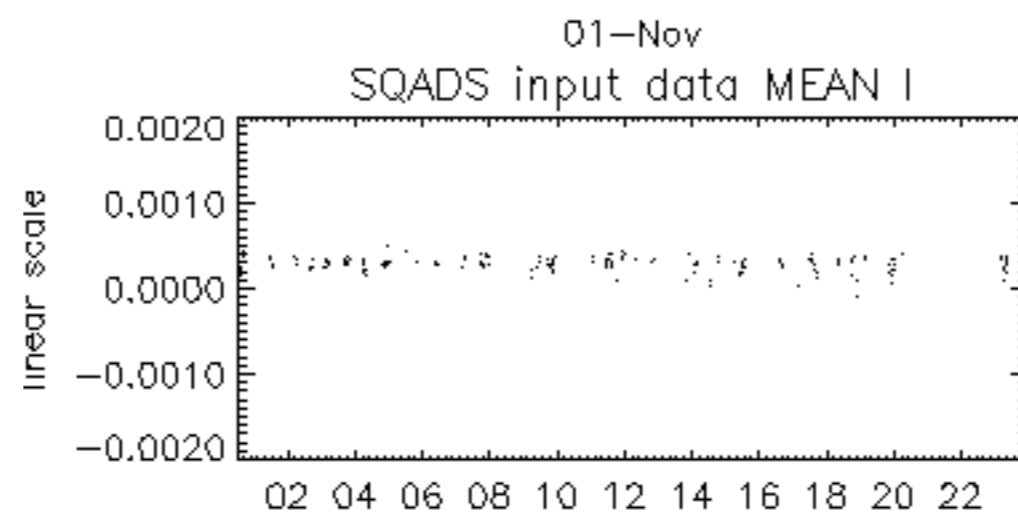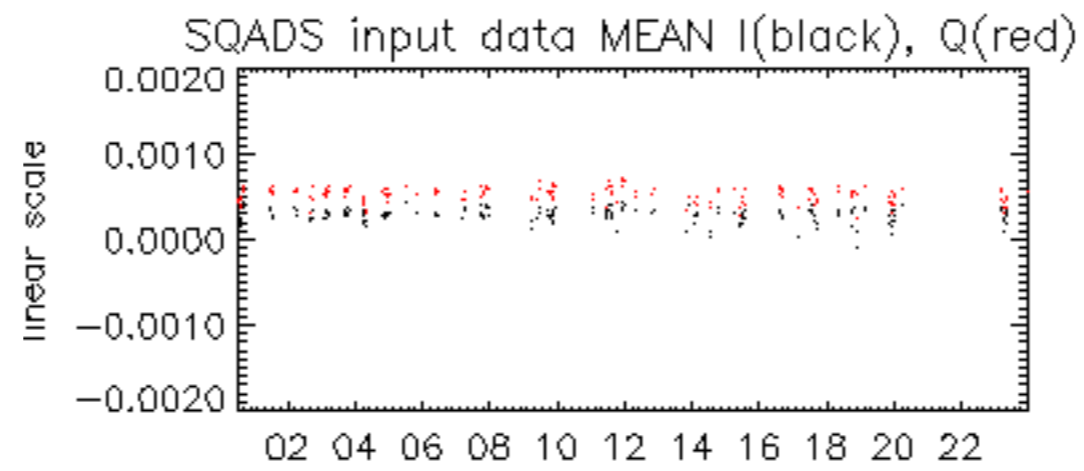

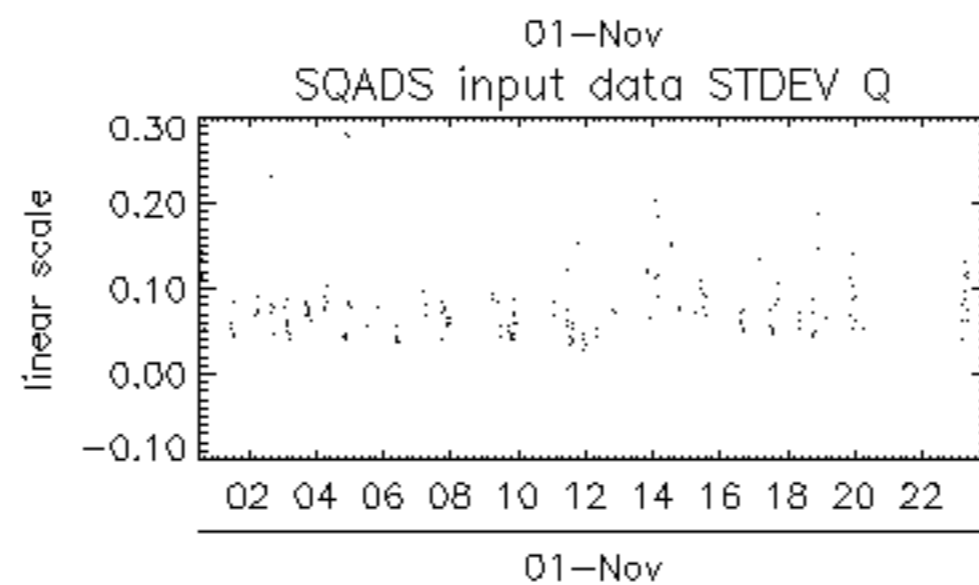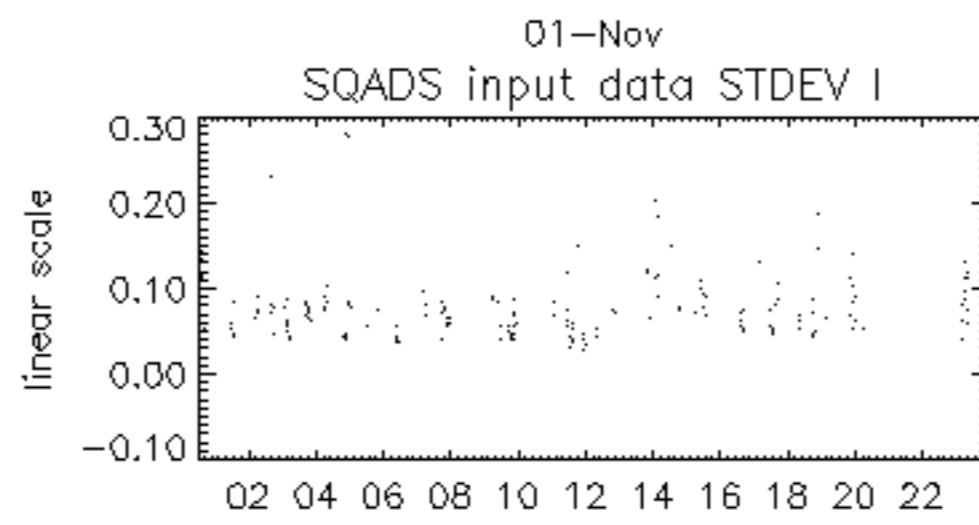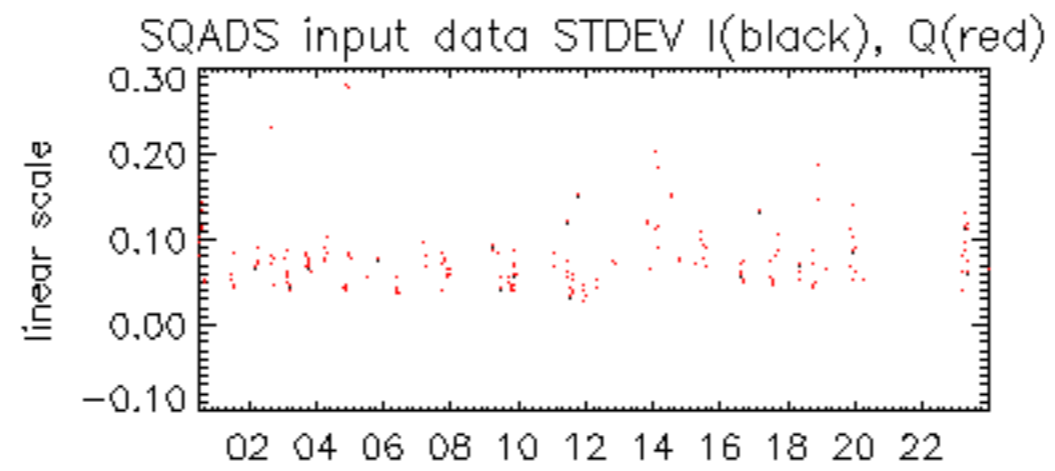


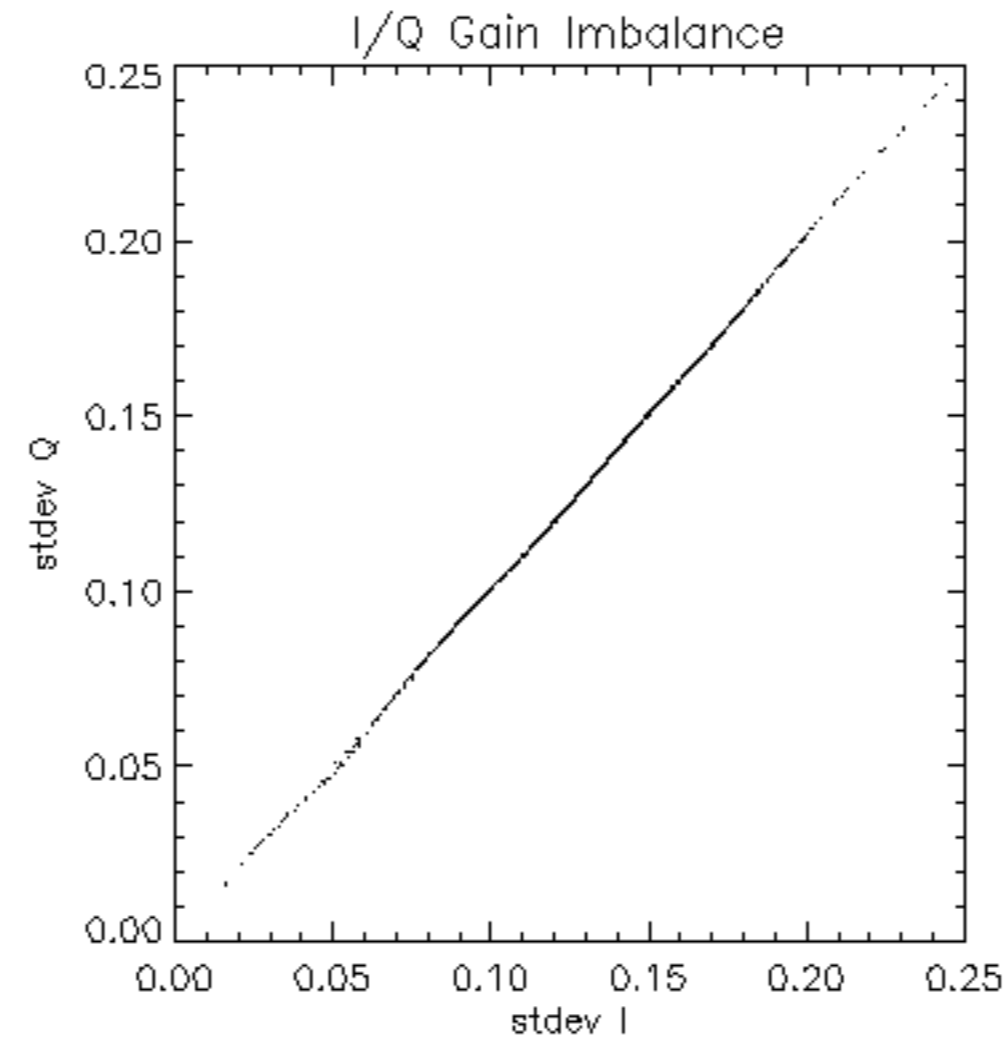

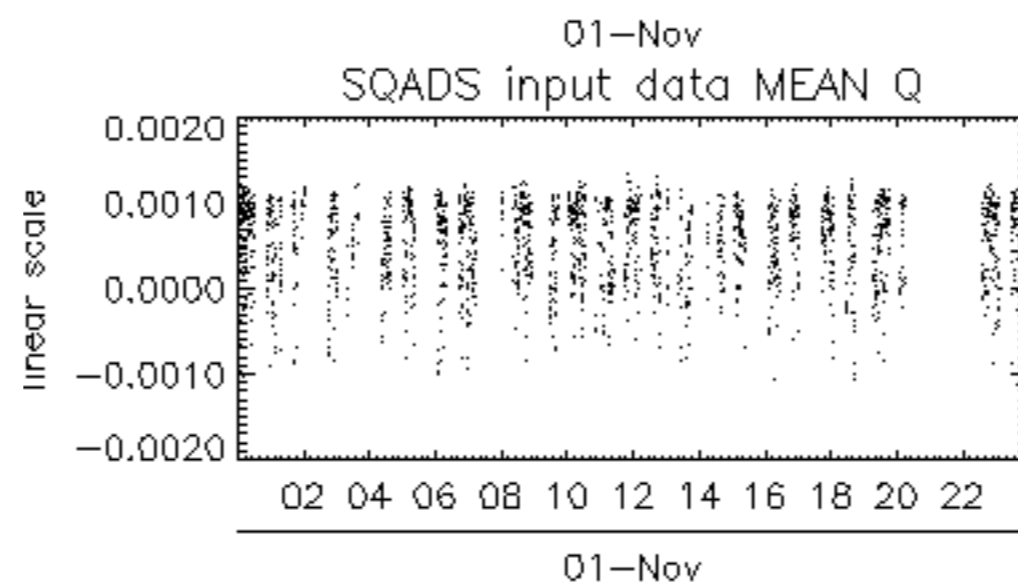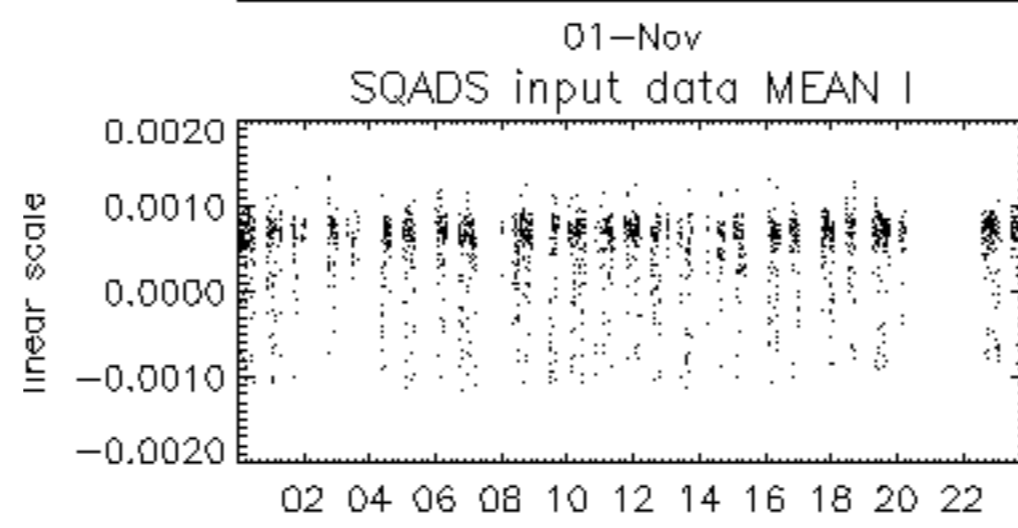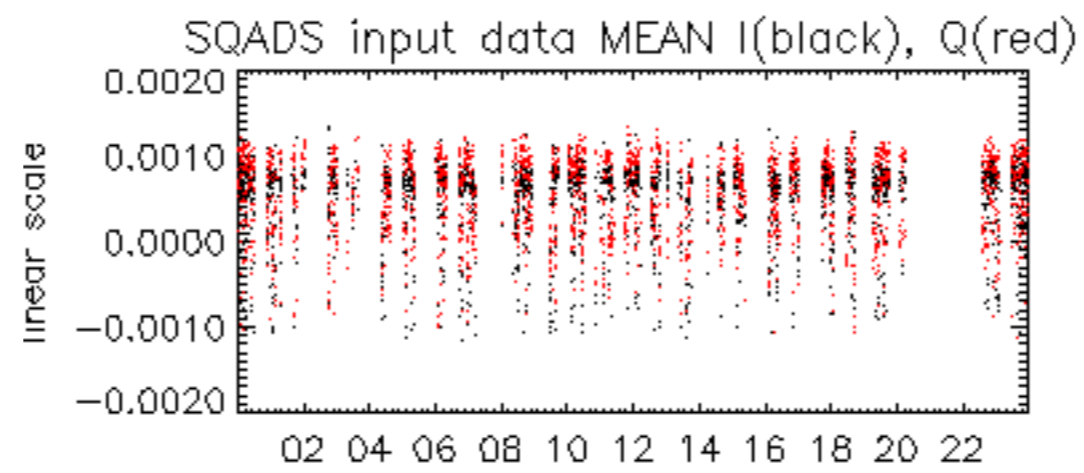


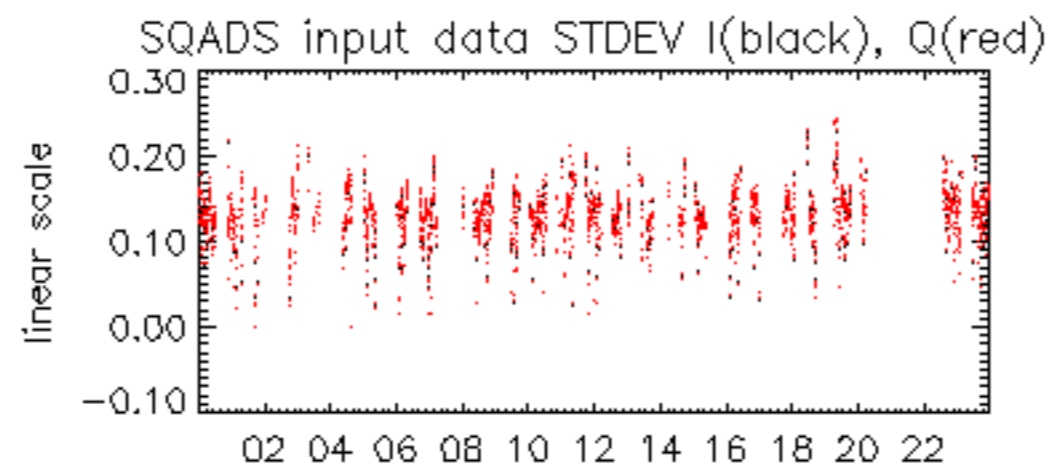

01-Nov

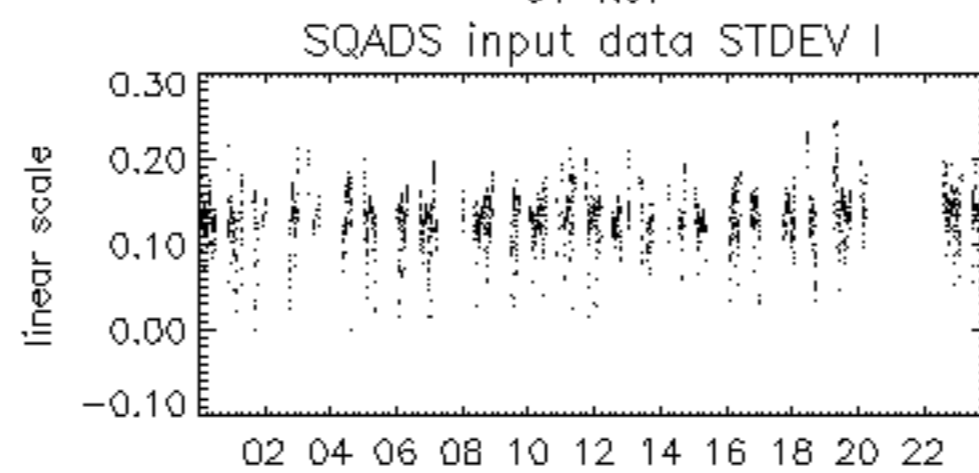

01-Nov

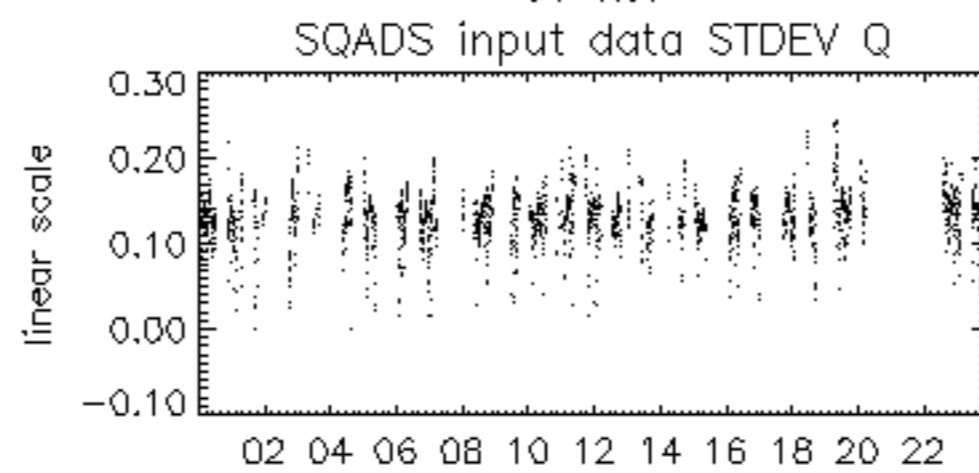

01-Nov

