



ASAR Daily Report



Analysis from 14-JAN-2009 00:00:00 to 14-JAN-2009 23:59:59. Page generated on 15-JAN-2009 07:41:51.
View log file: ASAR_Daily_Report_20090115_0730.log. For any anomalies please contact mtranfaglia@serco.it, gscarpino@serco.it, Emma.Griffiths@vega.co.uk.

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

SUMMARY

1. DATA SUMMARY
 - 1.1 Summary tables
 - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
 - 2.1 IECF operational ADFs list
 - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
 - 3.1 V/V polarisation
 - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
 - 4.1 Analysis for WVS IS2 V/V
 - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
 - 4.1.2 All Rows Analysis for WVS IS2 V/V
 - 4.2 Analysis for GM1 SS3 H/H
 - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
 - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
 - 5.1 Analysis for WVS IS2 V/V
 - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
 - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
 - 5.2 Analysis for GM1 SS1 H/H
 - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
 - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
 - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
 - 6.1 Analysis for WSM SS1 H/H
 - 6.1.1 ScaleFactor
 - 6.2 Analysis for WSM SS1 V/V
 - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
 - 7.1 Analysis for WVS
 - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
 - 8.1 Number of Missing Lines
 - 8.2 Number of Gaps

1 - DATA SUMMARY

1.1 - Summary tables

[[BACK TO MENU](#)]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	5	PDE	WS	H/H	34													PDK	2009-01-14 07:38:29	V	320
PDE	IS2	V/V	27	PDK	WS	H/H	42																
PDK	IS2	V/V	28																				

1.2 - Lists of products used

[[BACK TO MENU](#)]

[[TXT](#)] [[XLS](#)] [List_WVS_products_used](#)

[[TXT](#)] [[XLS](#)] [List_GM1_products_used](#)

[[TXT](#)] [[XLS](#)] [List_MS_products_used](#)

2 - AUXILIARY FILES ANALYSIS

2.1 - IECF operational ADFs list

[[BACK TO MENU](#)]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20081215_141339_20070204_165113_20091231_000000
ASA_INS_AXVIEC20081215_140905_20070307_060000_20091231_000000
ASA_XCH_AXVIEC20081215_143642_20020301_000000_20091231_000000
ASA_XCA_AXVIEC20081215_141741_20070204_165113_20091231_000000

2.2 - Products with wrong ADFs

[[BACK TO MENU](#)]



Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0




[[TXT](#)] [[XLS](#)] [Check_ADFs_WVS](#)

[[TXT](#)] [[XLS](#)] [Check_ADFs_GM1](#)

3 - MODULE STEPPING PRODUCTS ANALYSIS

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
After antenna maintenance (2005-09-22/23)	Previous product in the same polarisation



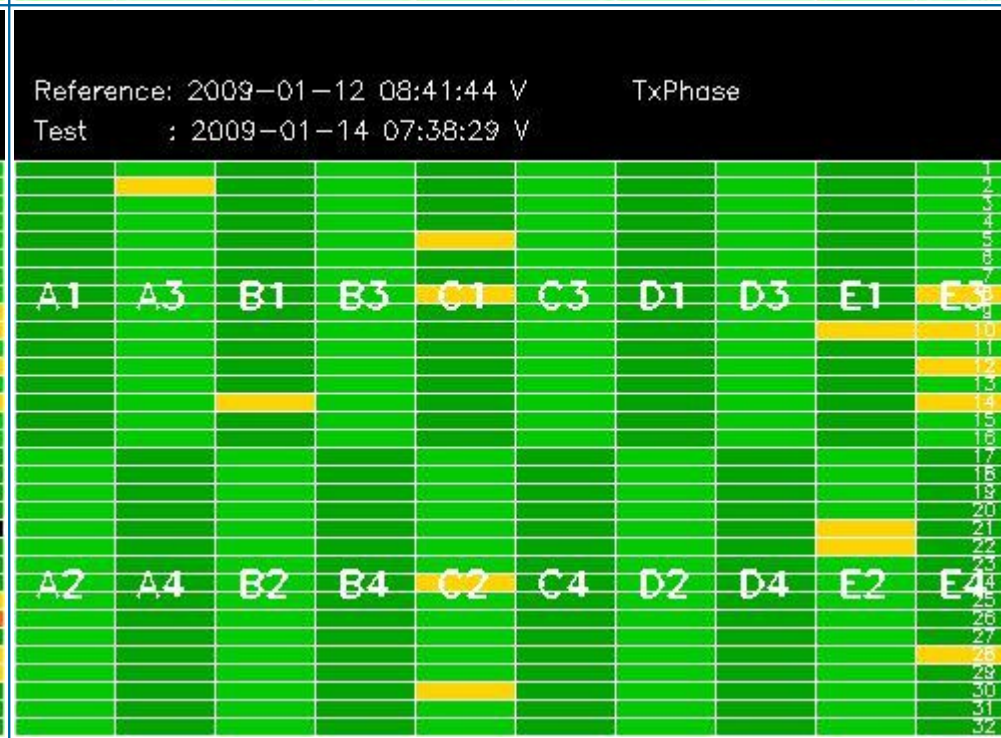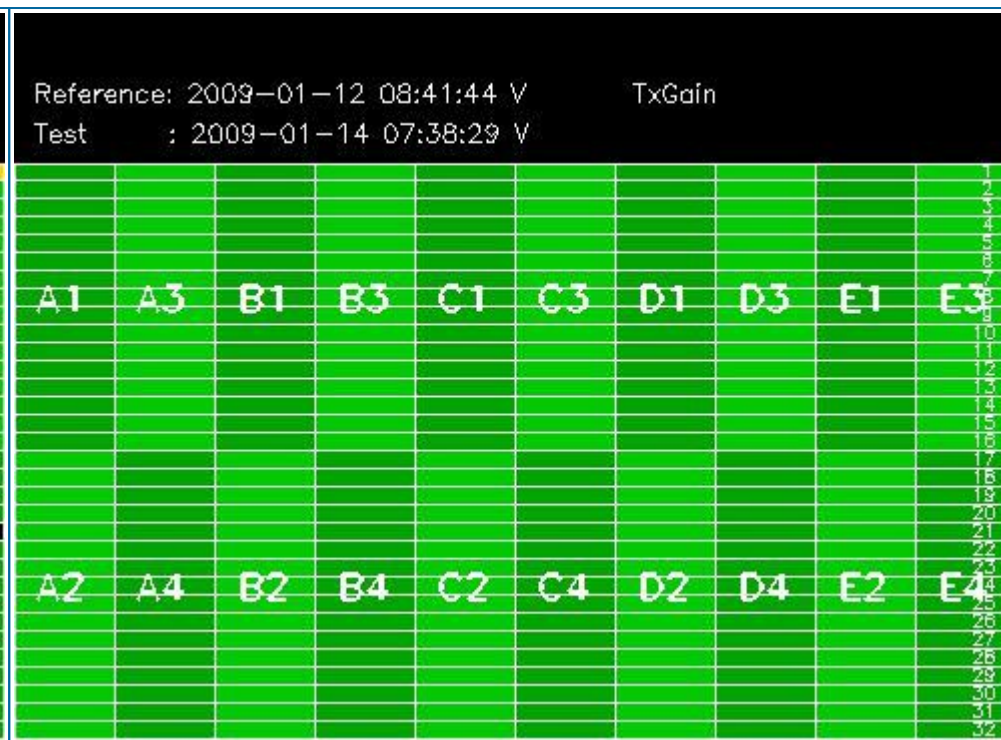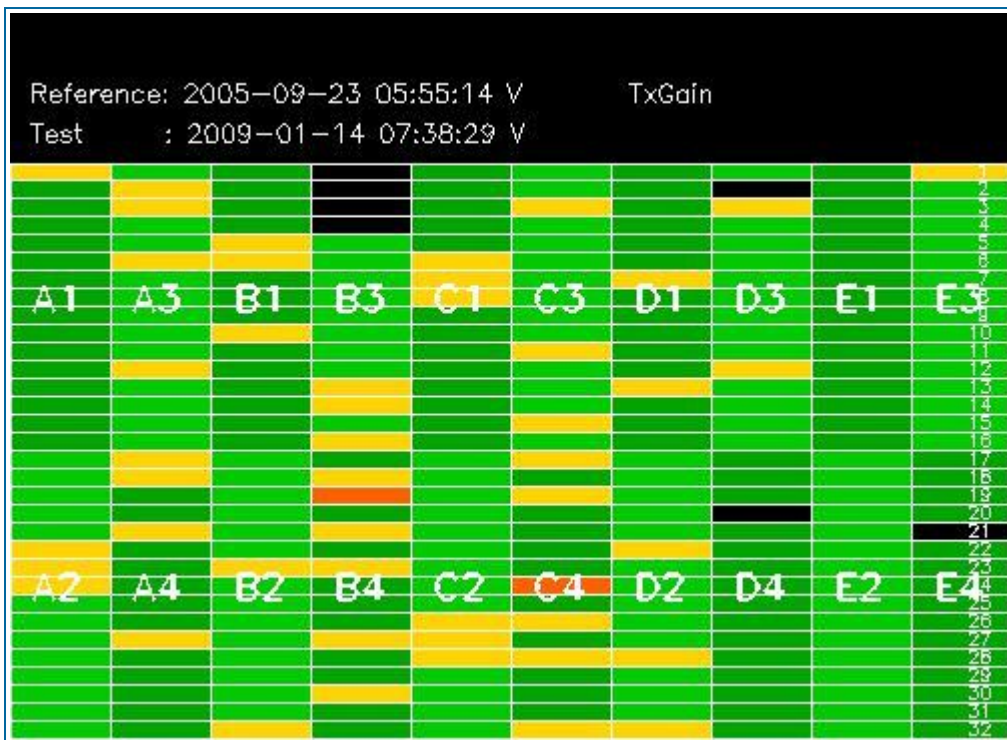


3.2 - H/H polarisation

[[BACK TO MENU](#)]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
After antenna maintenance (2005-09-22/23)	Previous product in the same polarisation

Reference: 2005-09-22 06:26:51 H RxGain
 Test : 2009-01-13 08:10:07 H

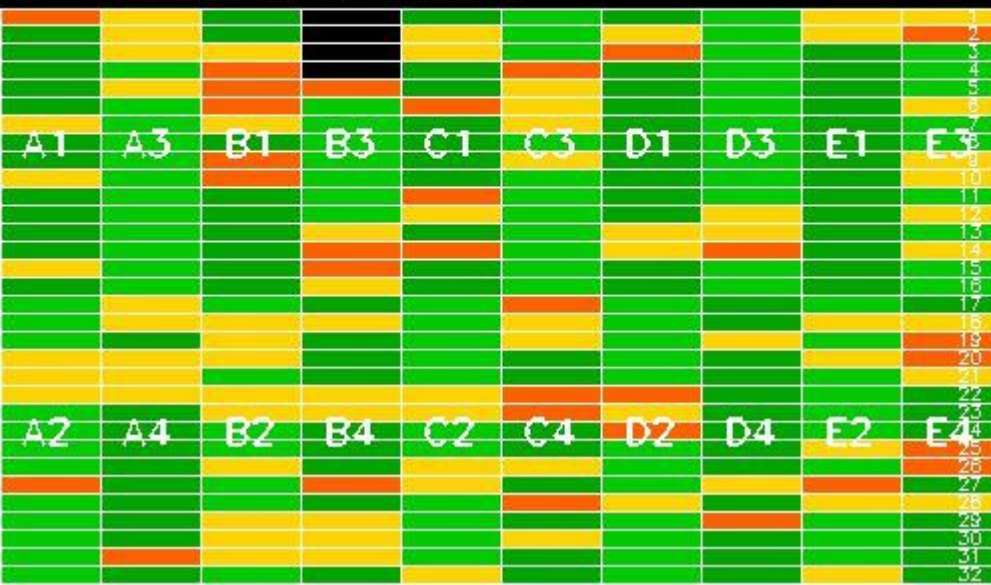


Reference: 2009-01-12 01:59:20 H RxGain
 Test : 2009-01-13 08:10:07 H





Reference: 2005-09-22 06:26:51 H RxPhase
 Test : 2009-01-13 08:10:07 H



Reference: 2009-01-12 01:59:20 H RxPhase
 Test : 2009-01-13 08:10:07 H

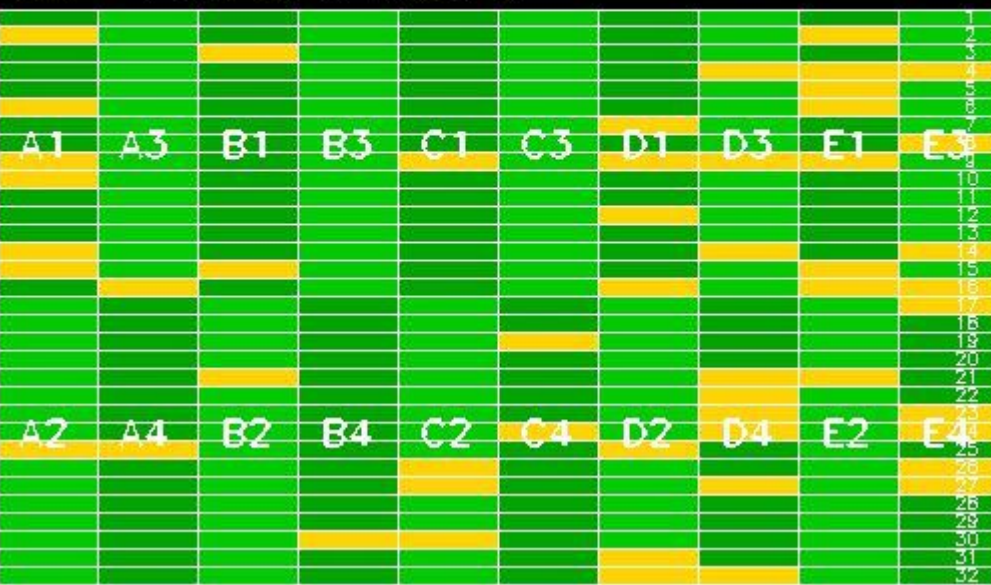

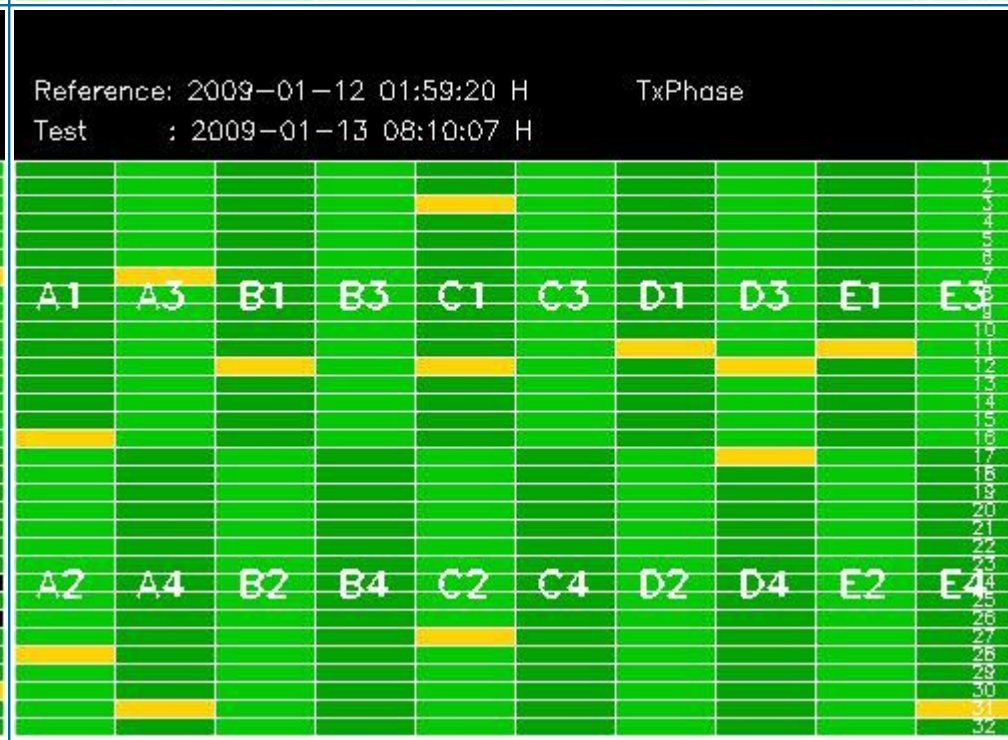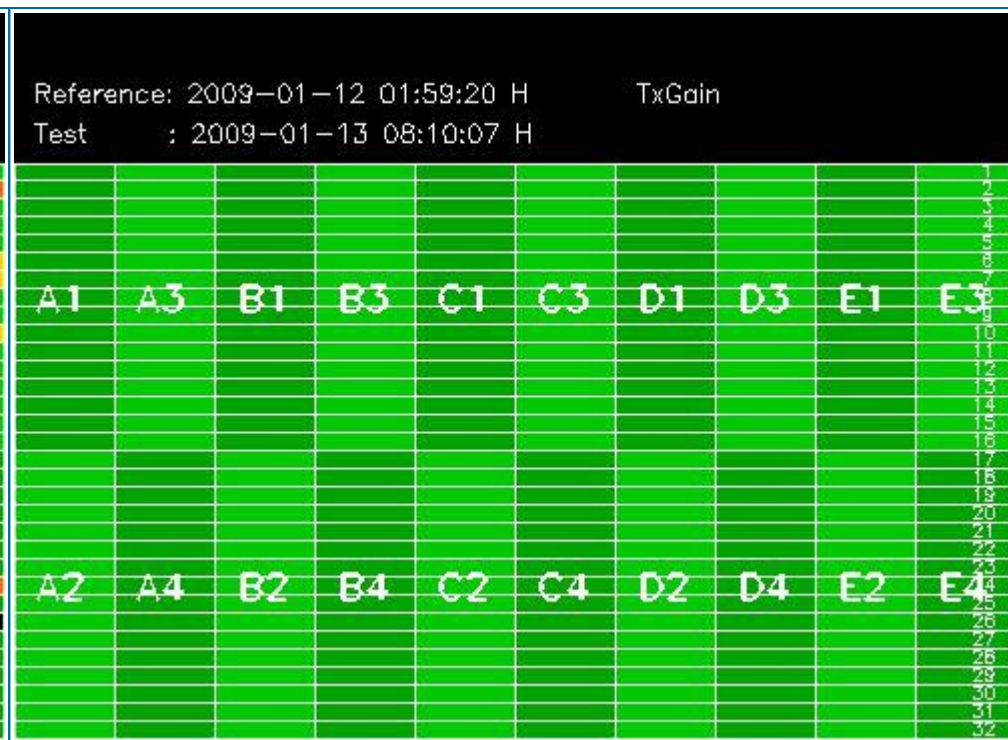

4 - CALIBRATION PULSES ANALYSIS

4.1 - Analysis for WVS IS2 V/V


4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for WVS IS2 V/V

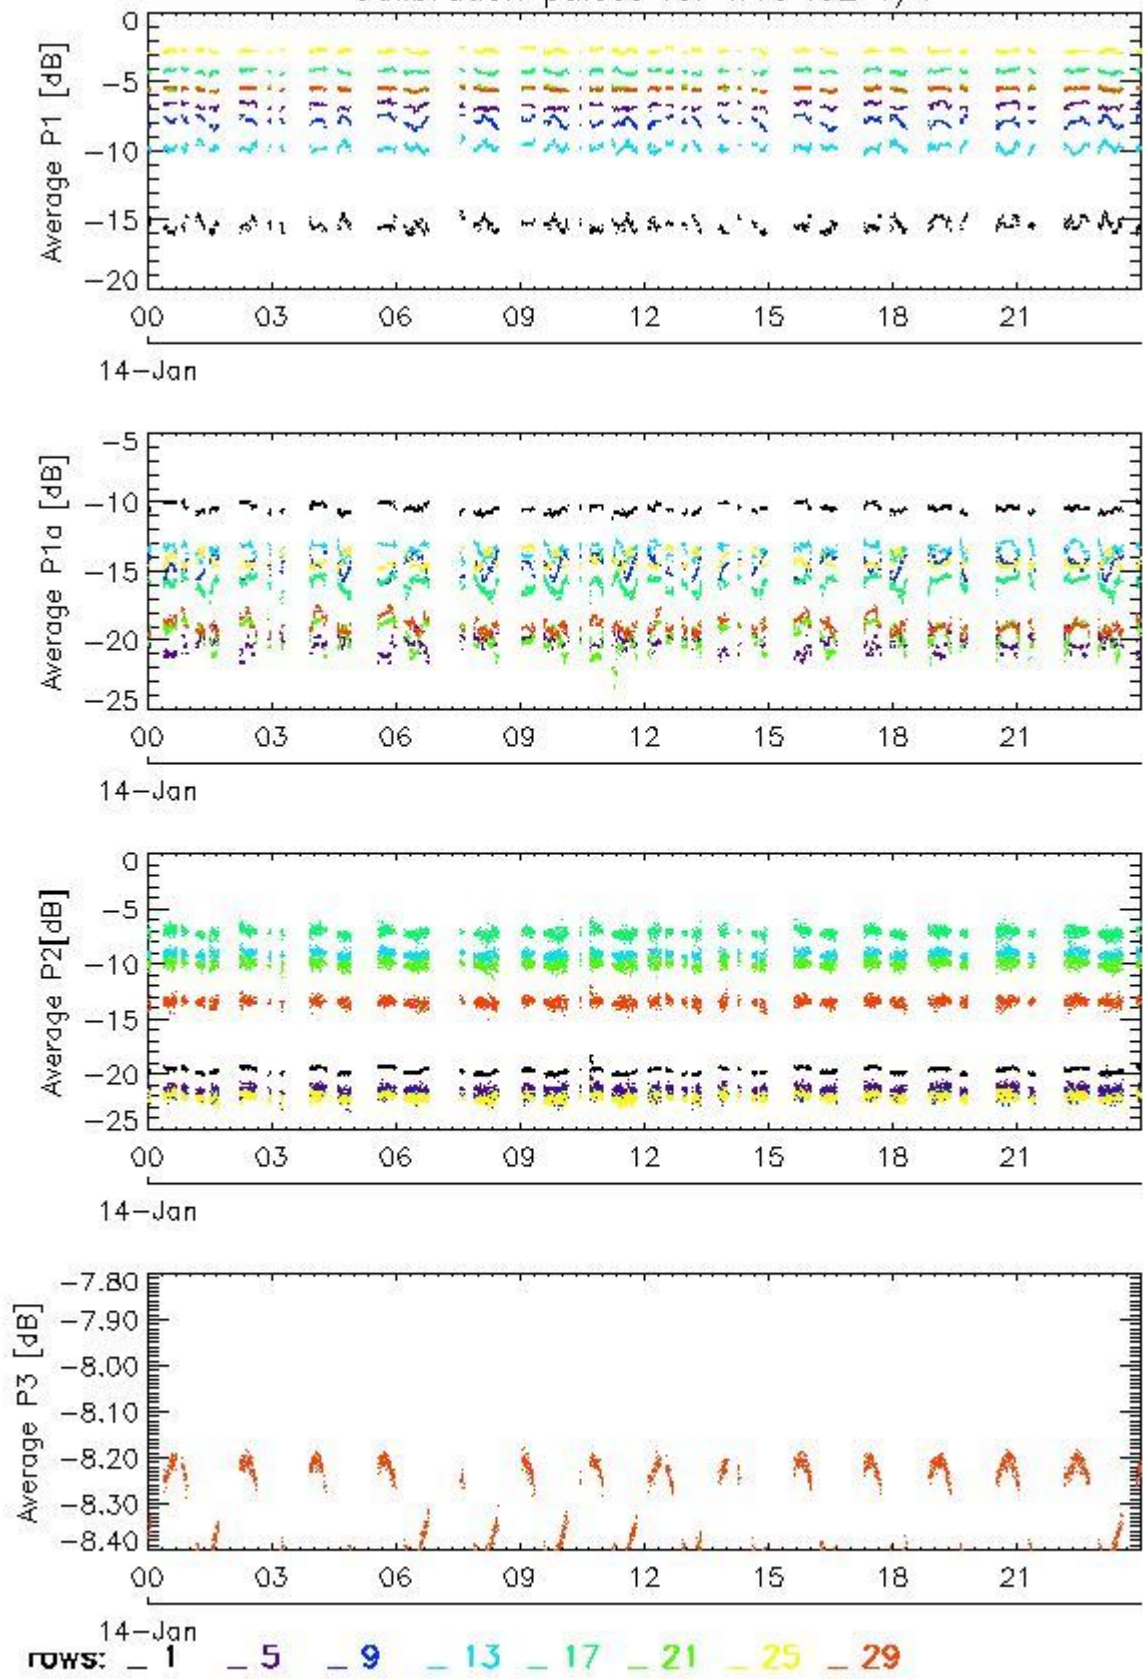


Transmit power (P1 - P1a) for WVS IS2 V/V

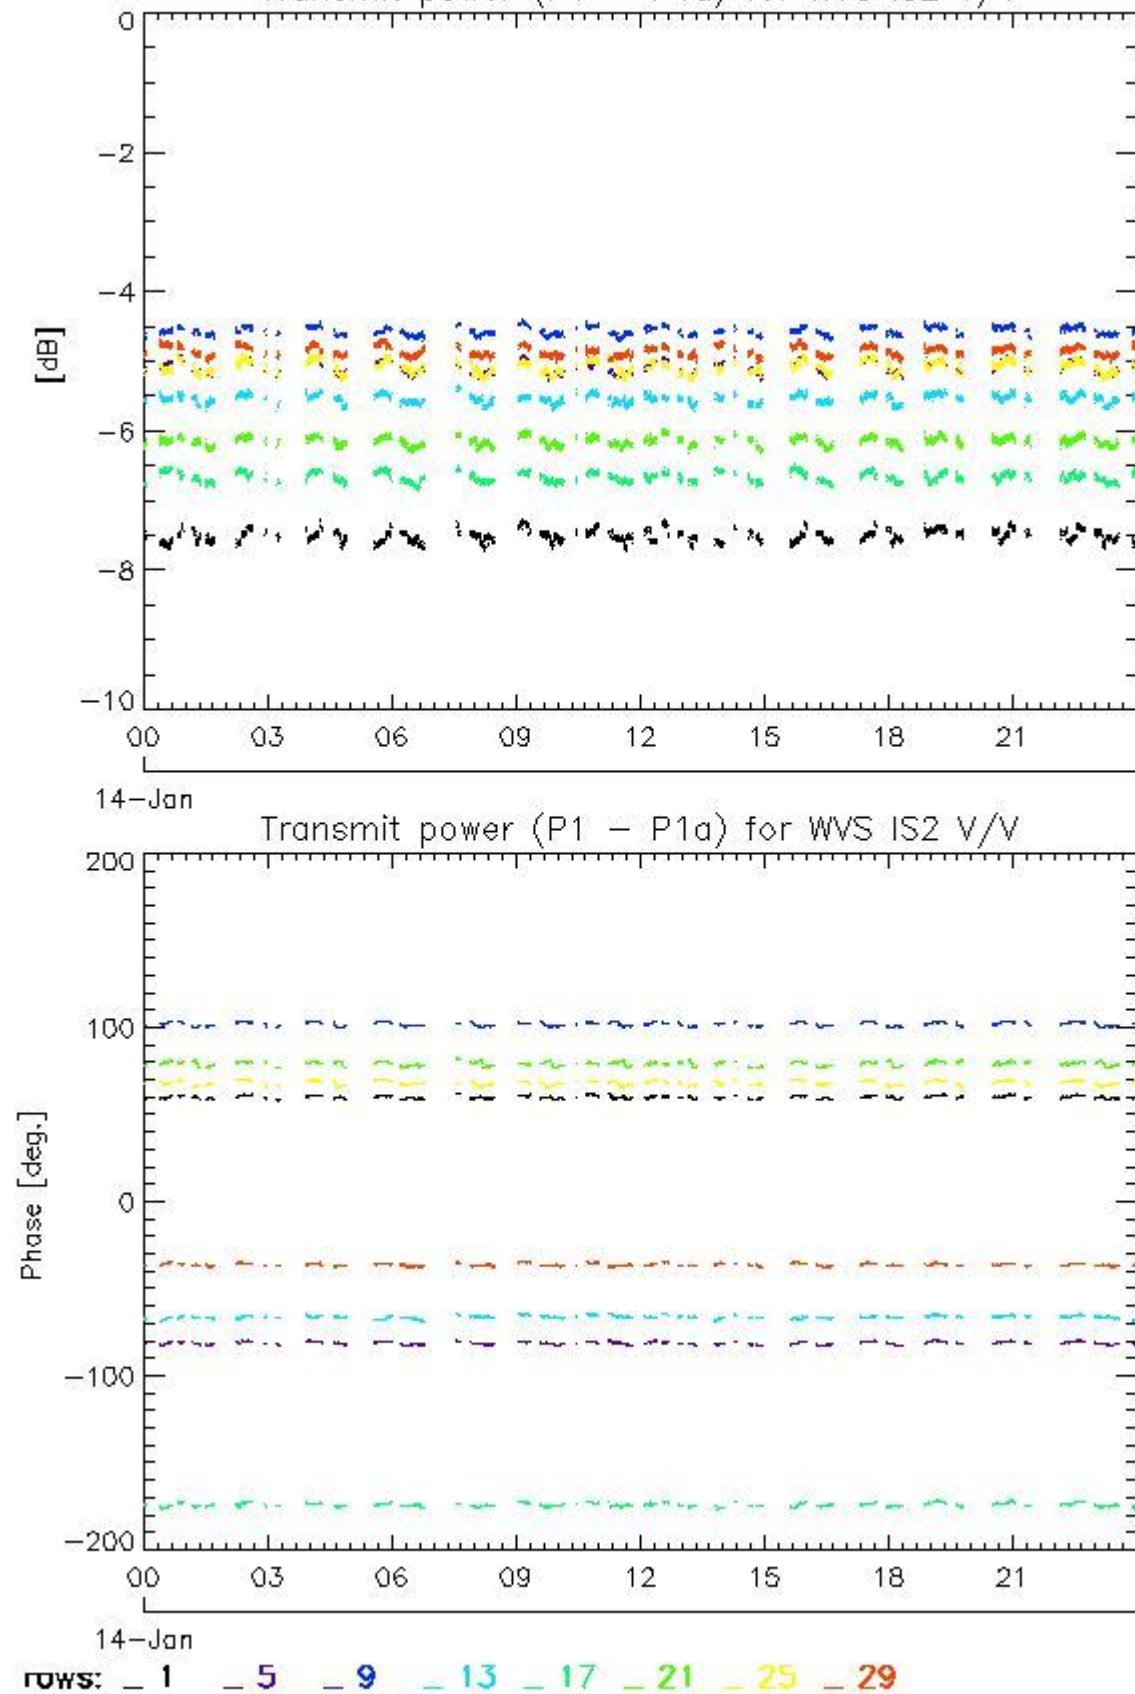

4.1.2 - All Rows Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



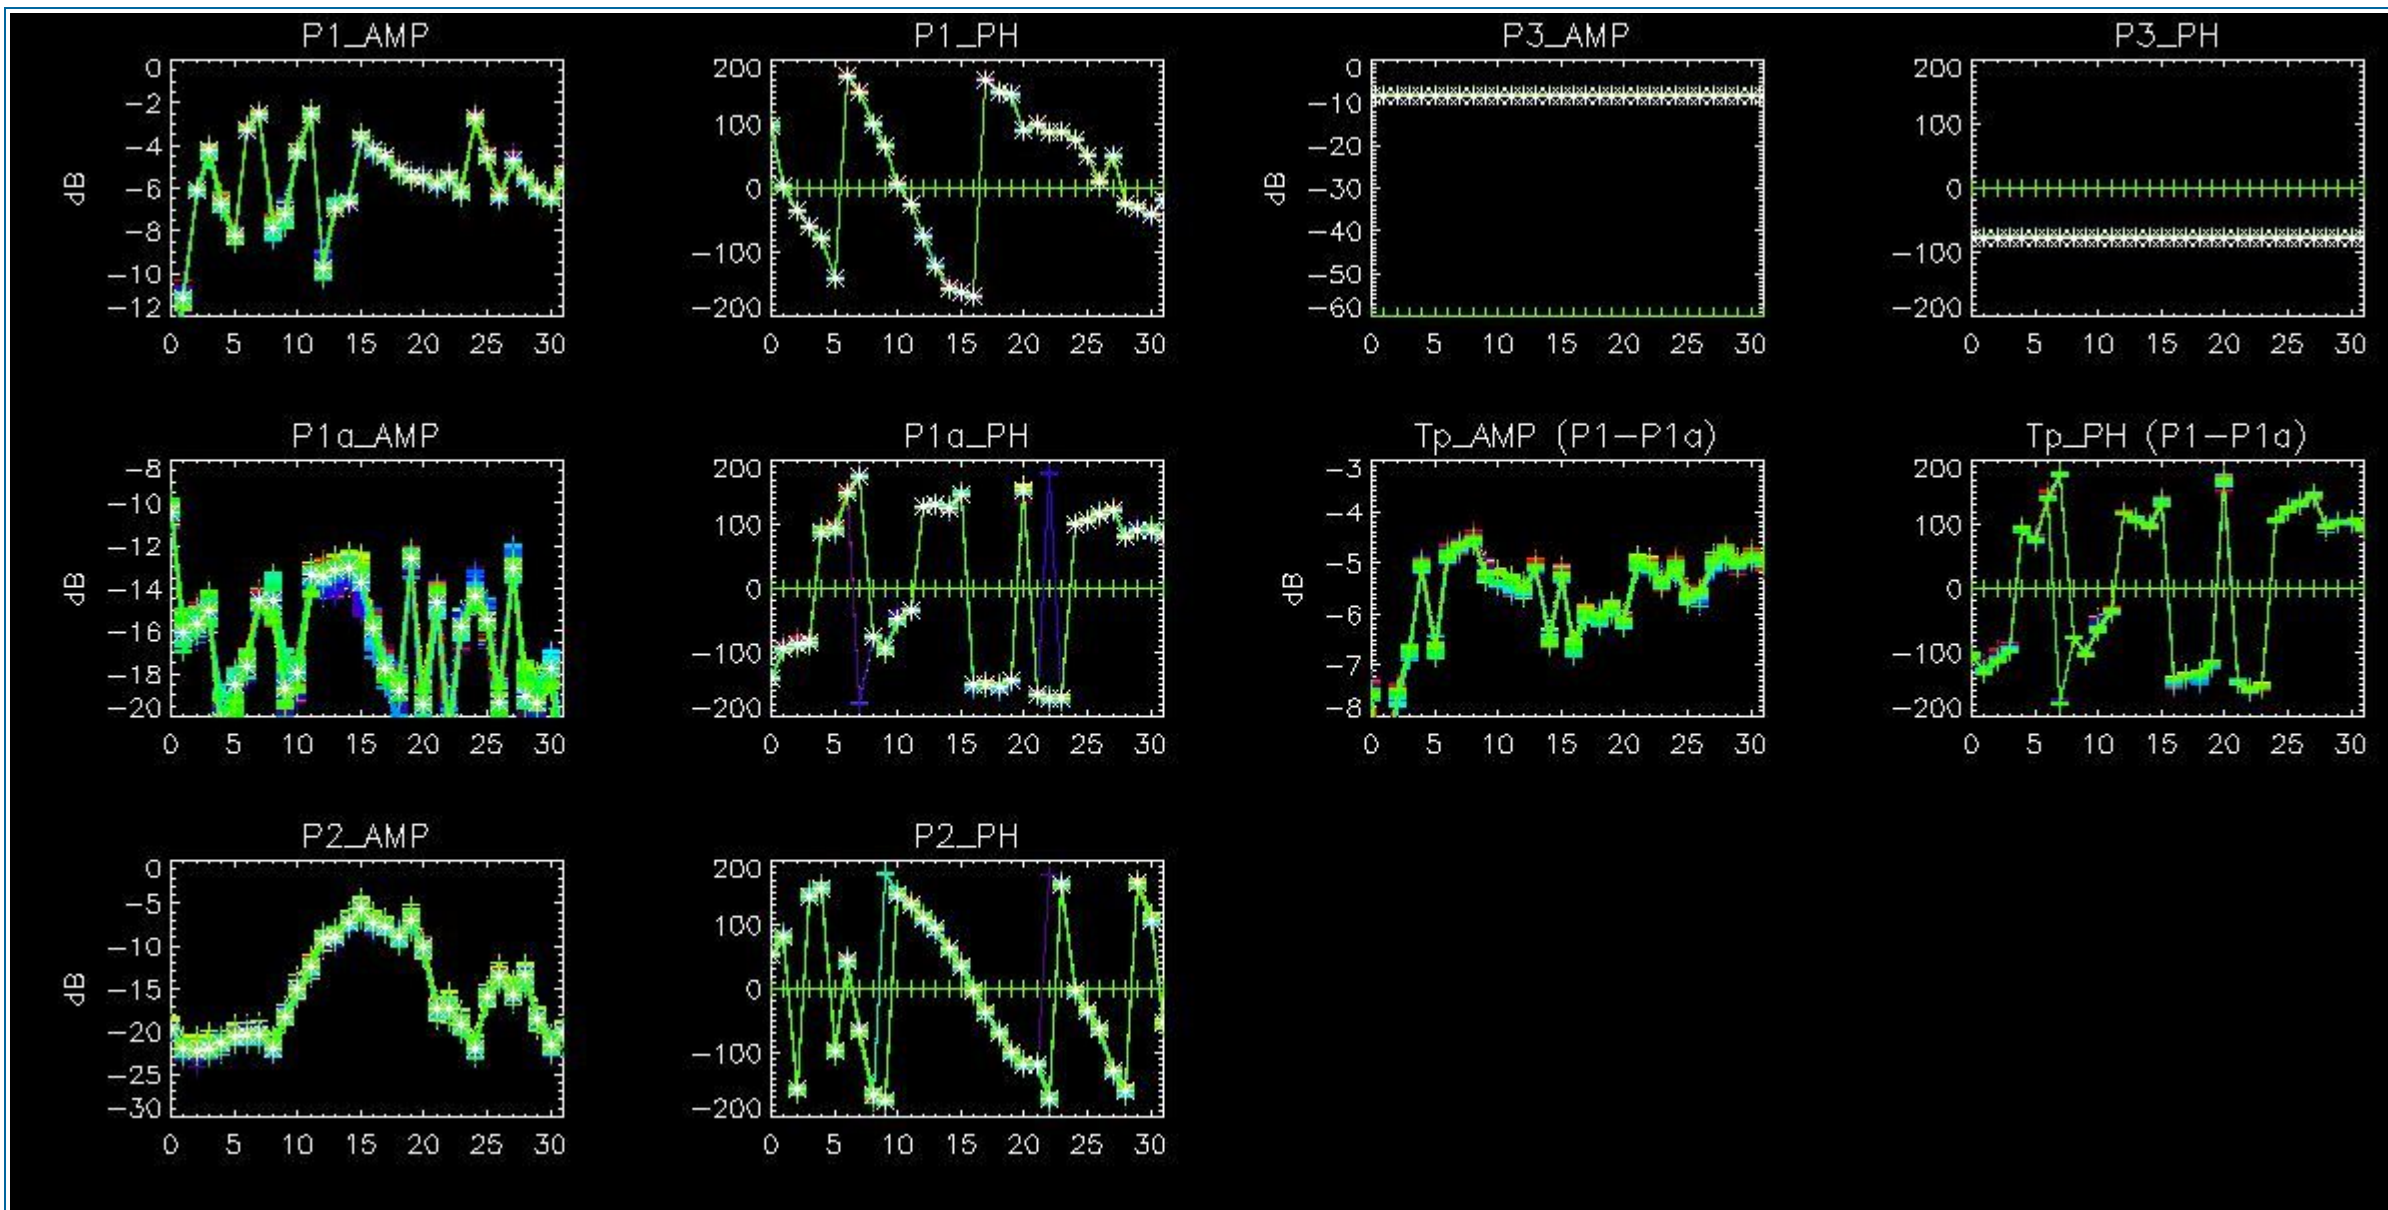

4.2 - Analysis for GM1 SS3 H/H


4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for GM1 SS3 H/H

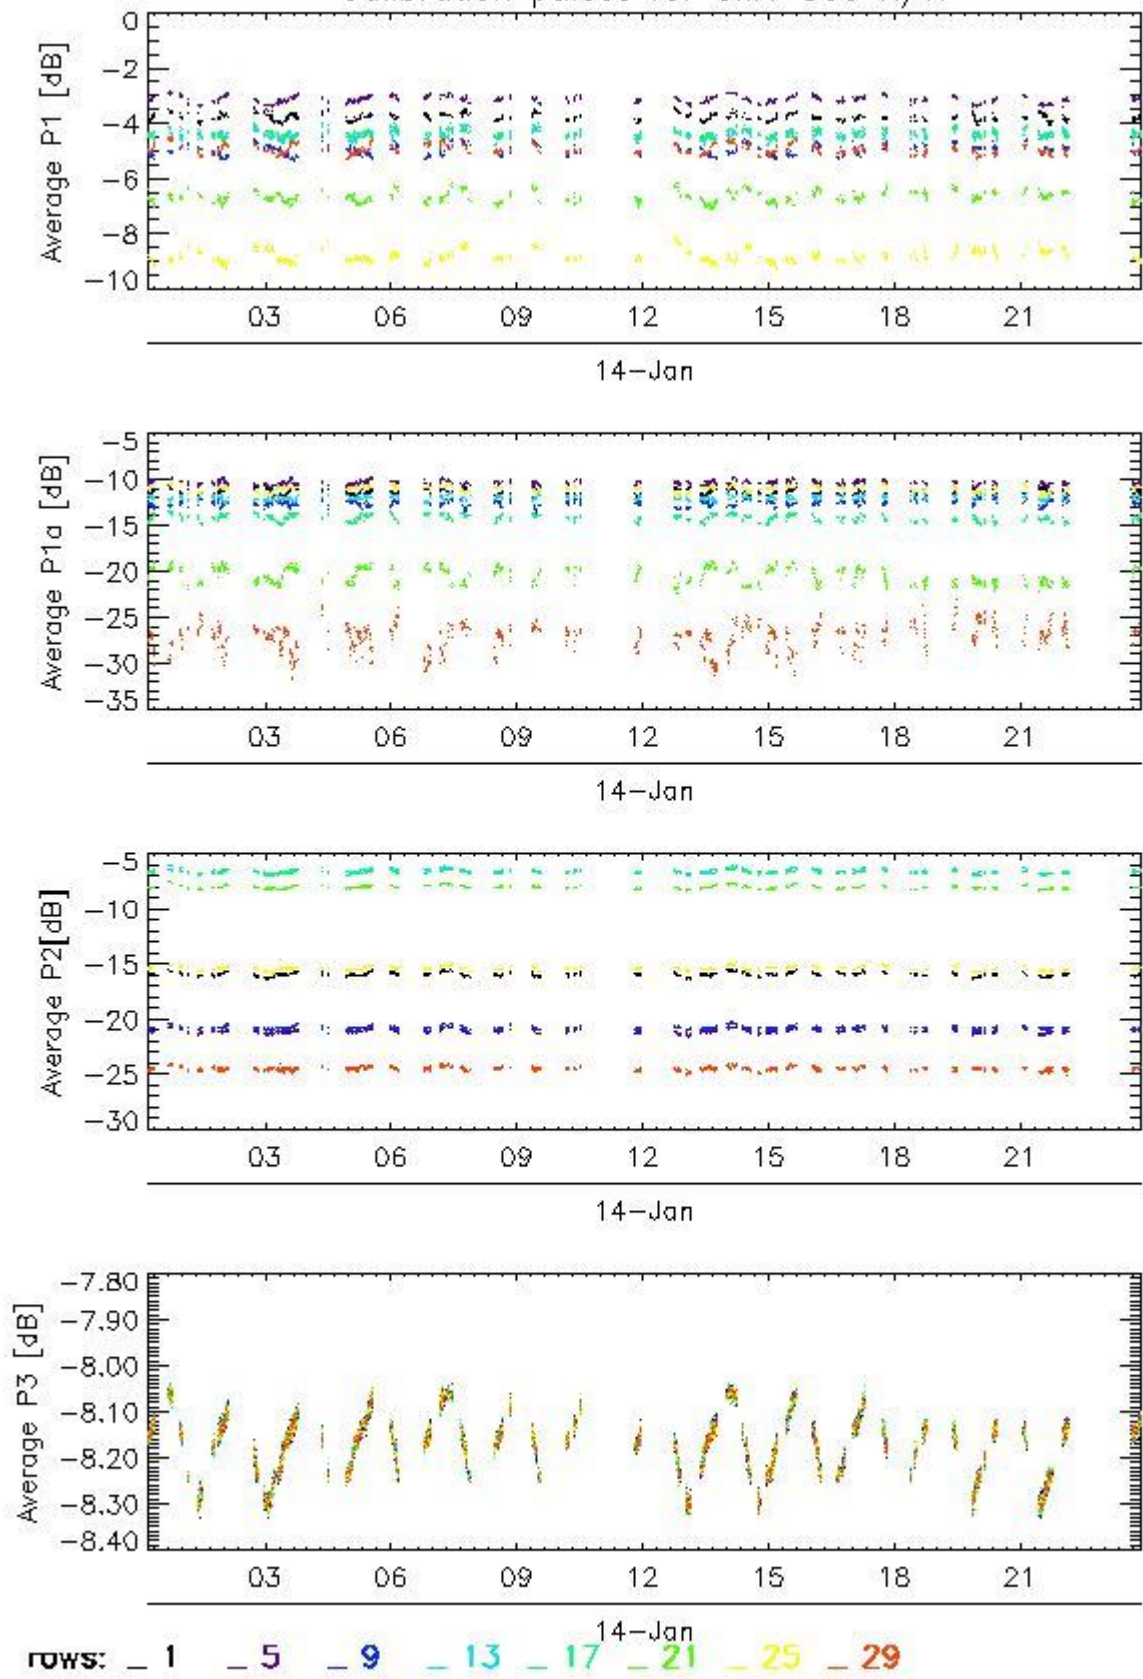


Transmit power (P1 - P1a) for GM1 SS3 H/H

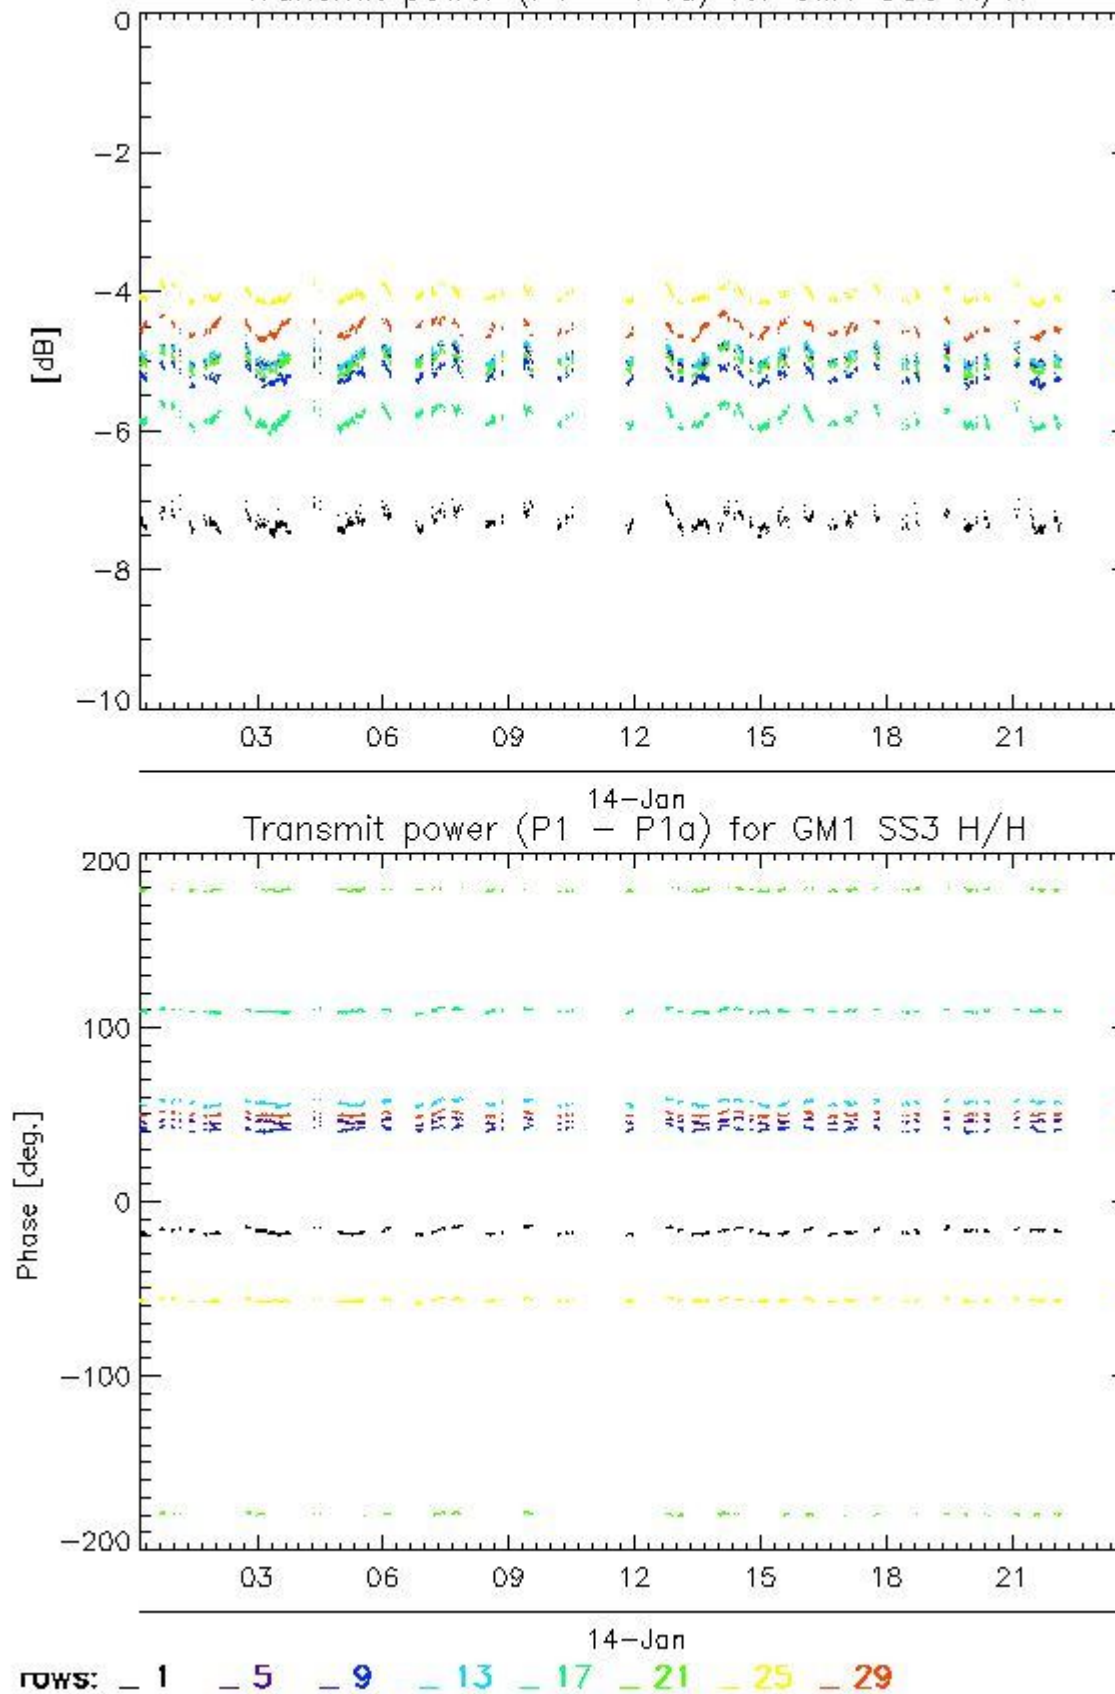

4.2.2 - All Rows Analysis for GM1 SS3 H/H

[[BACK TO MENU](#)]



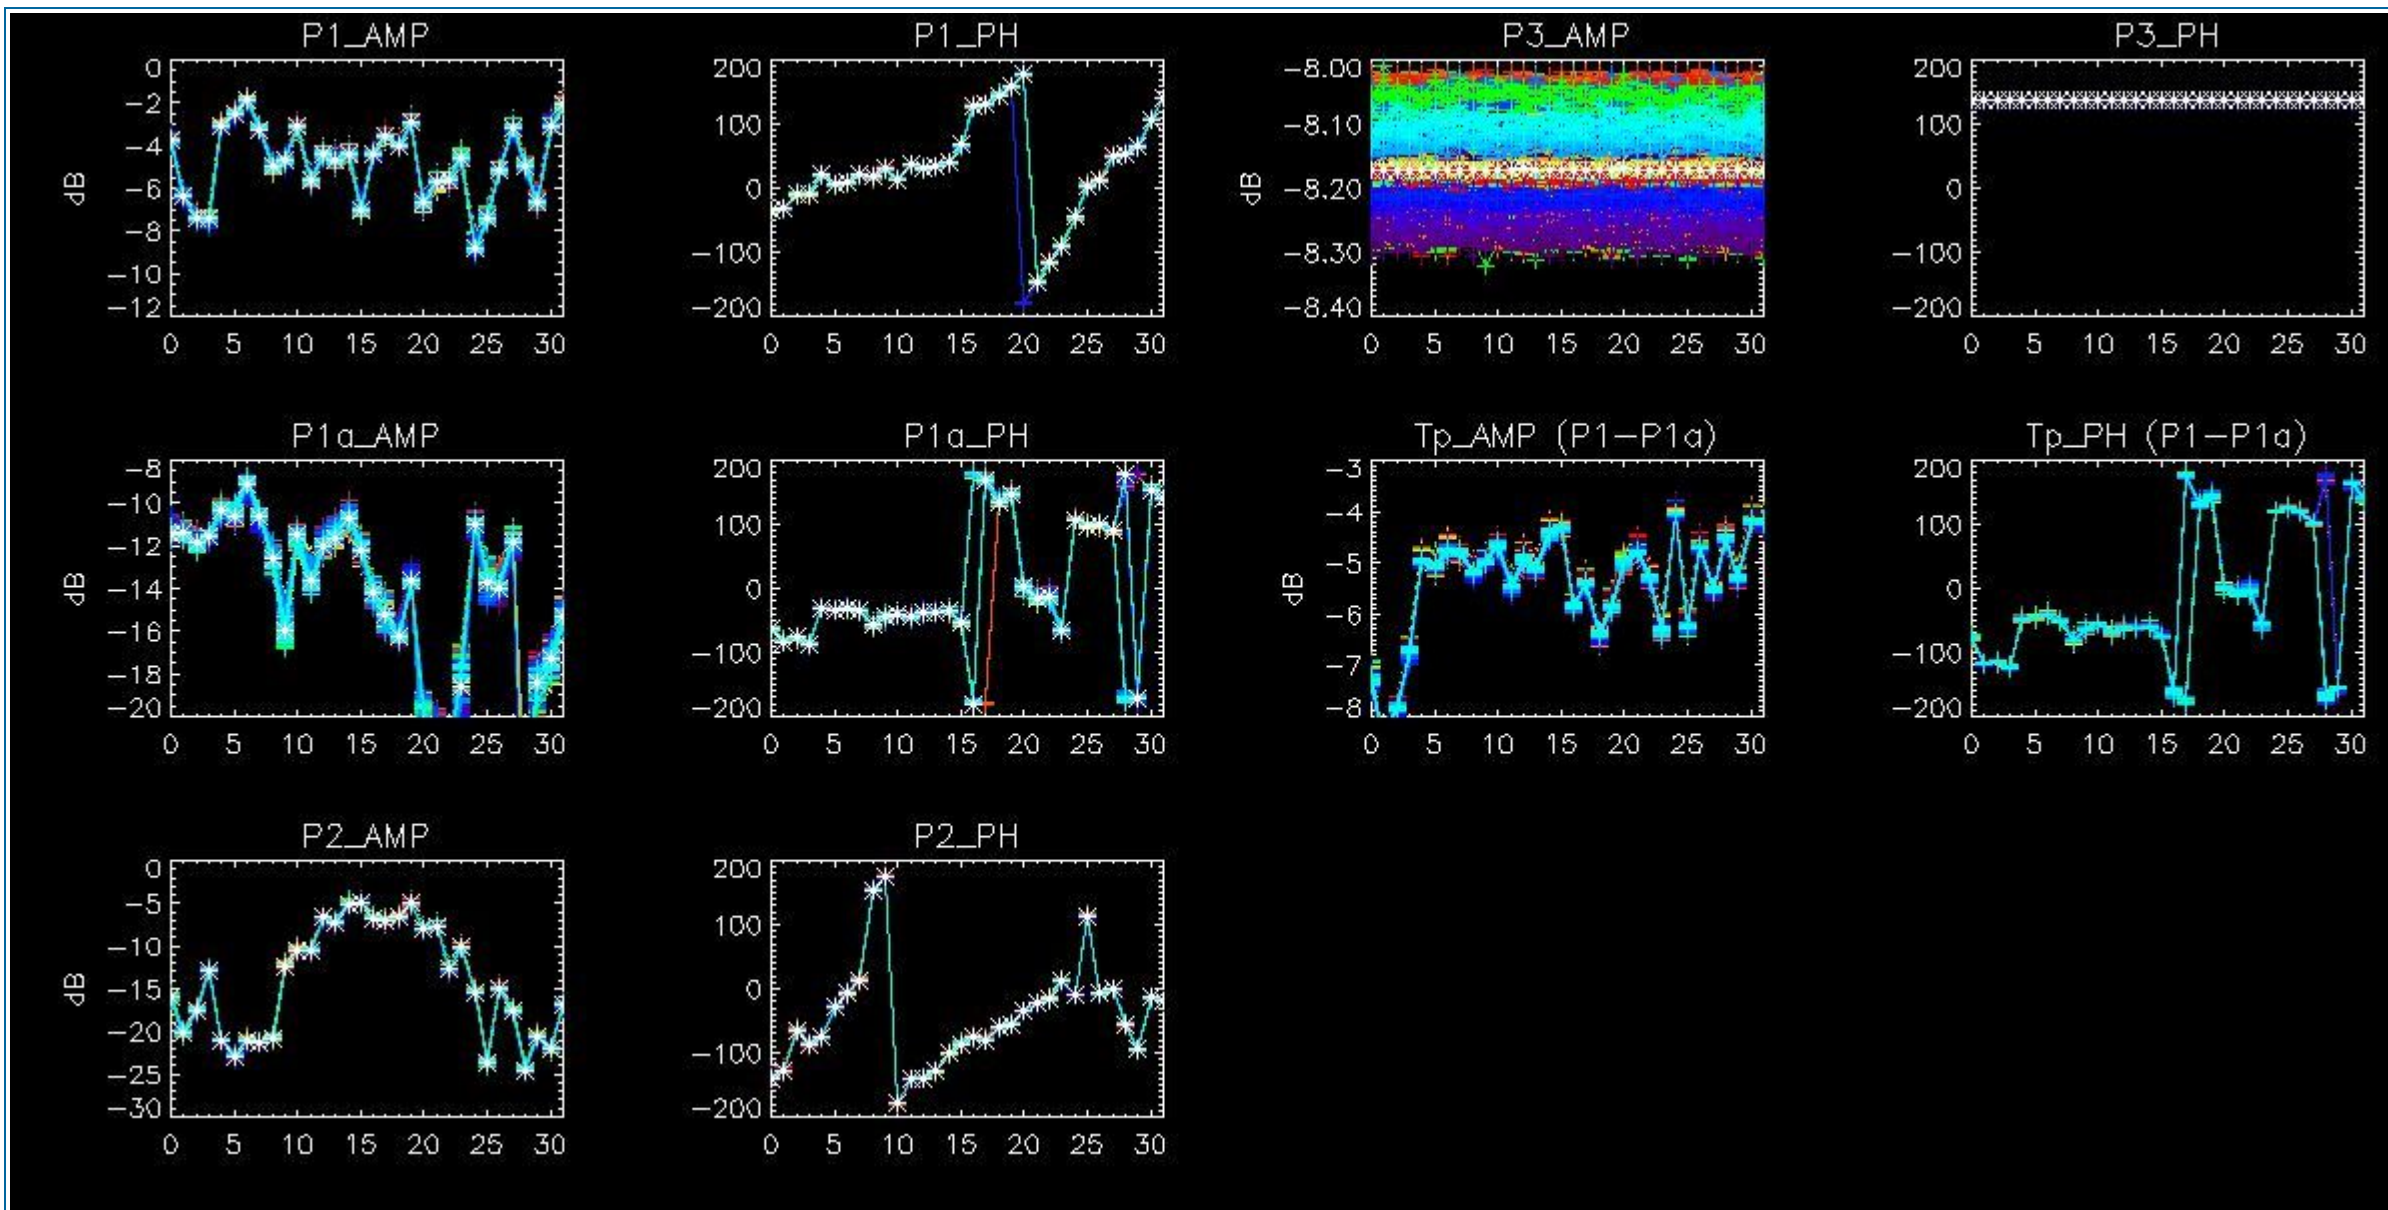


5 - DOPPLER ANALYSIS

5.1 - Analysis for WVS IS2 V/V

5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]




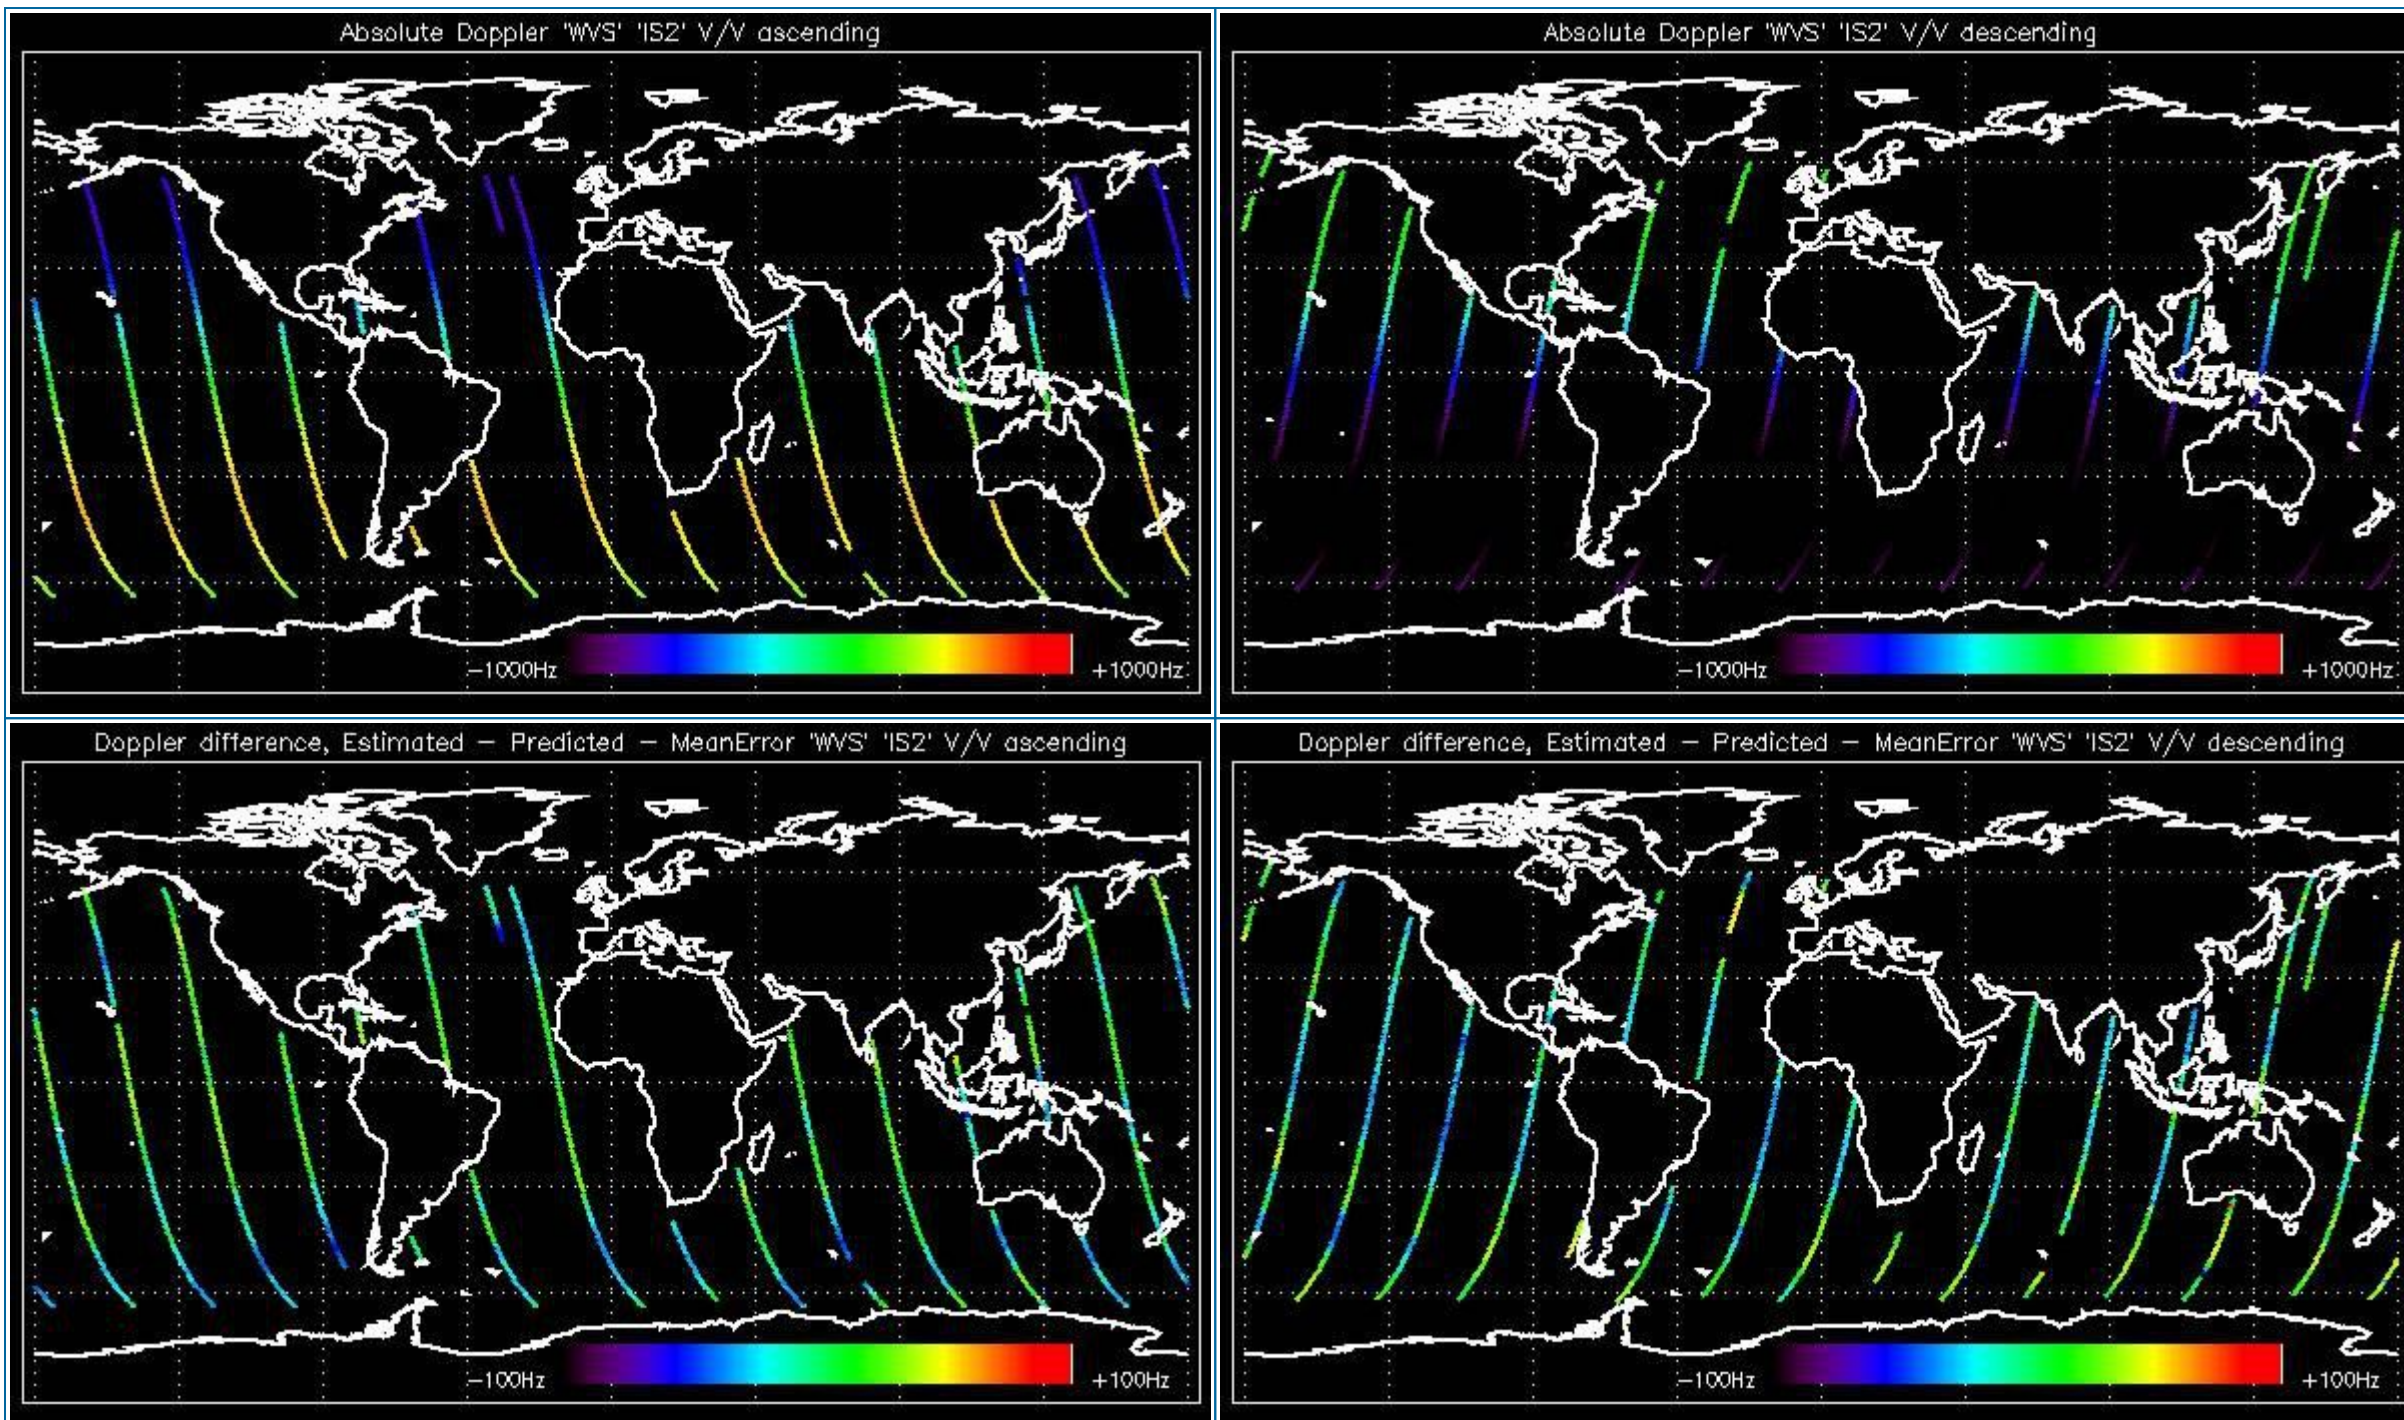

5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



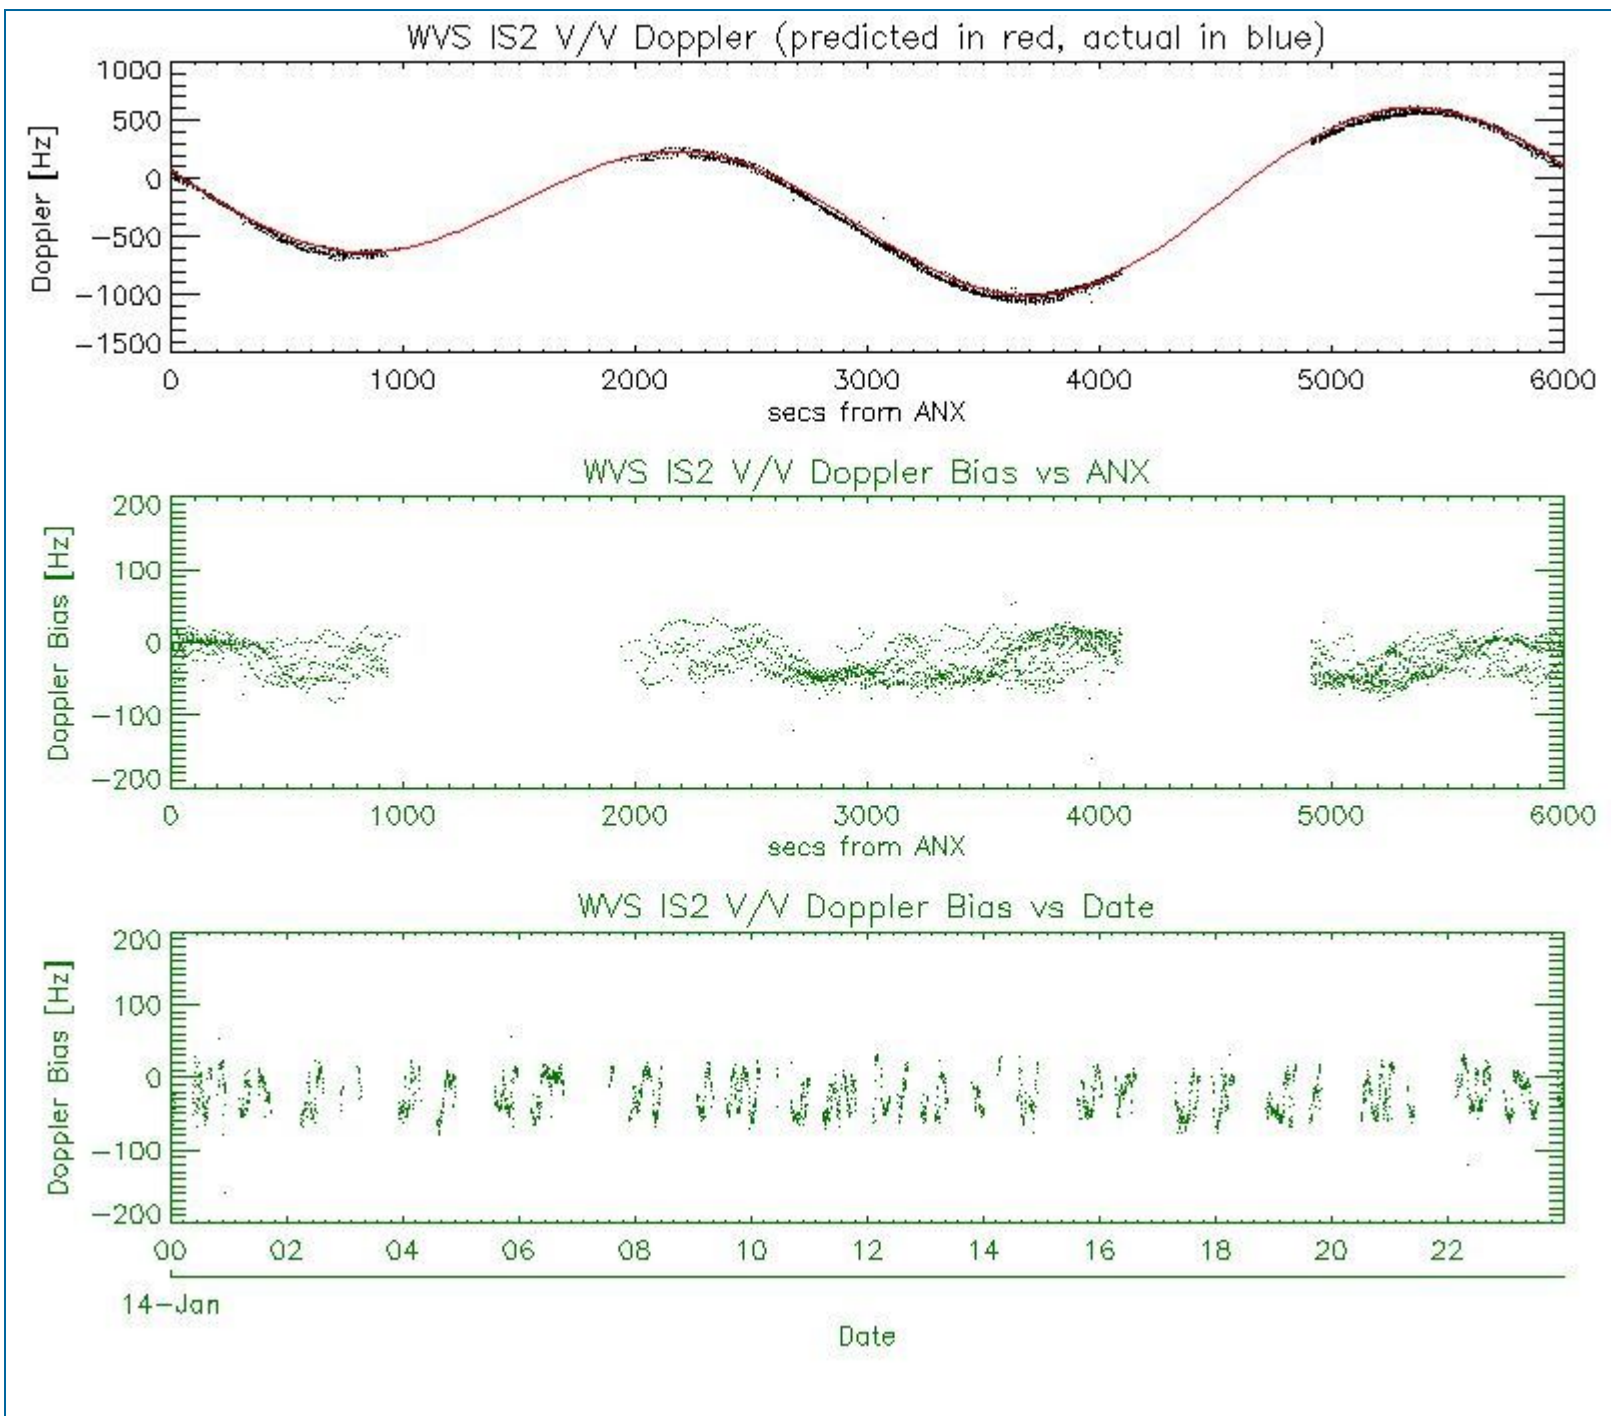


5.2 - Analysis for GM1 SS1 H/H

5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




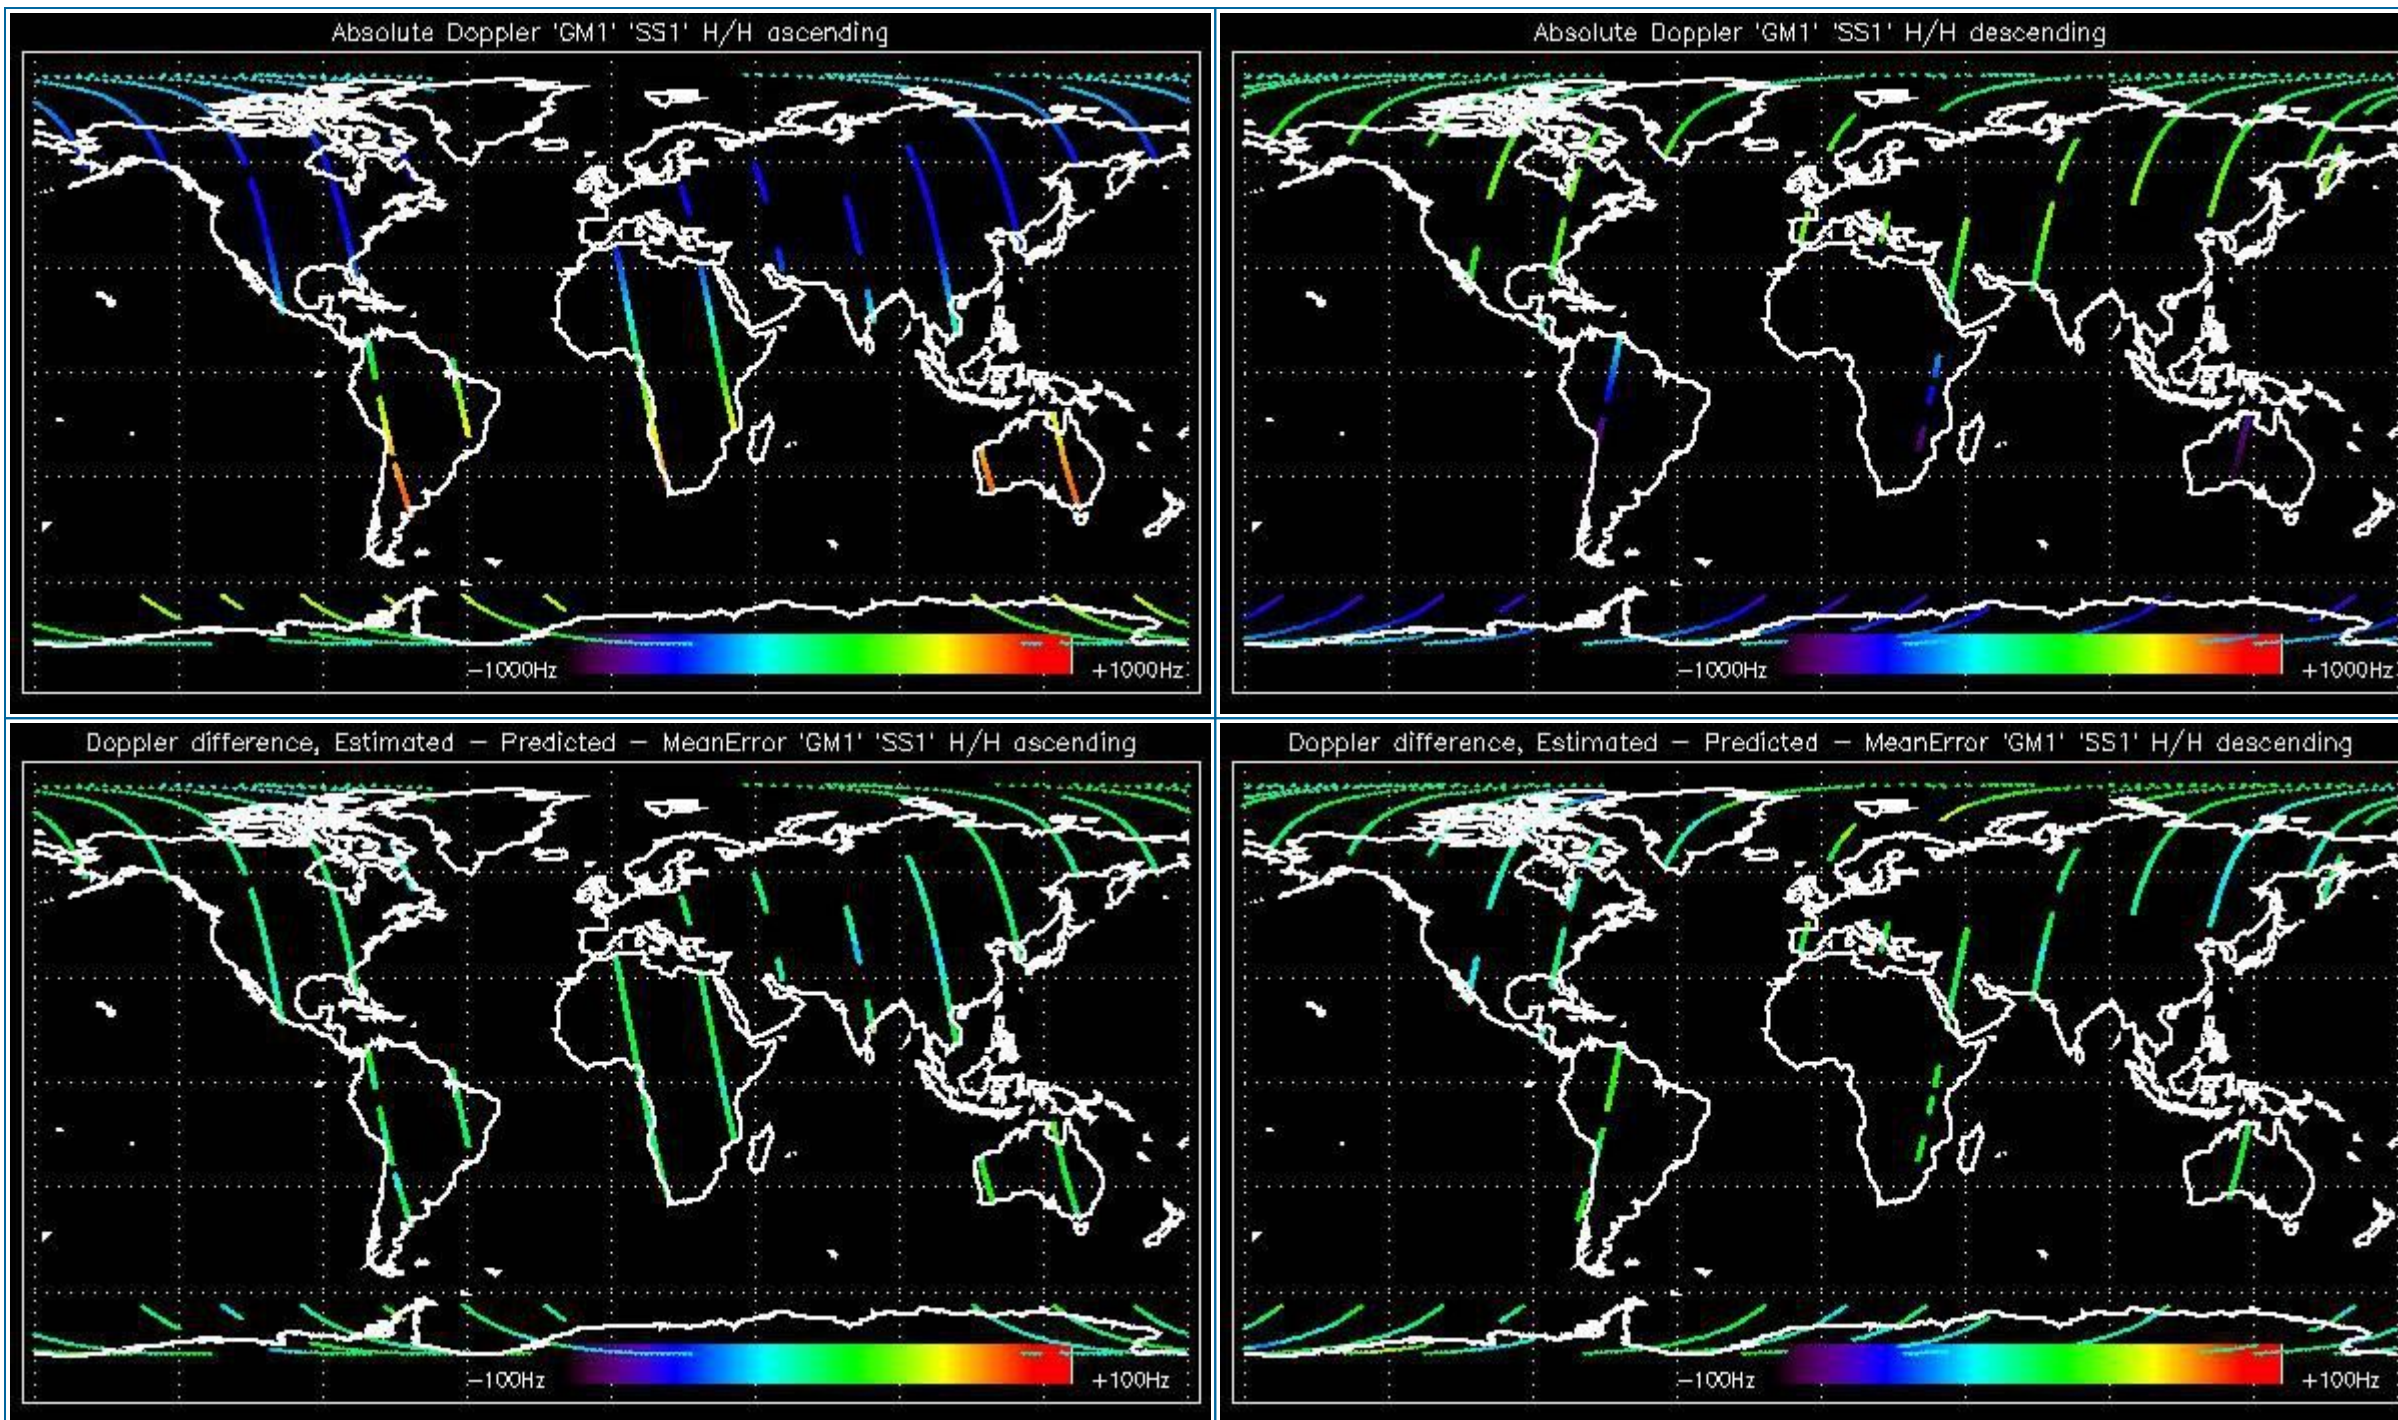

5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]



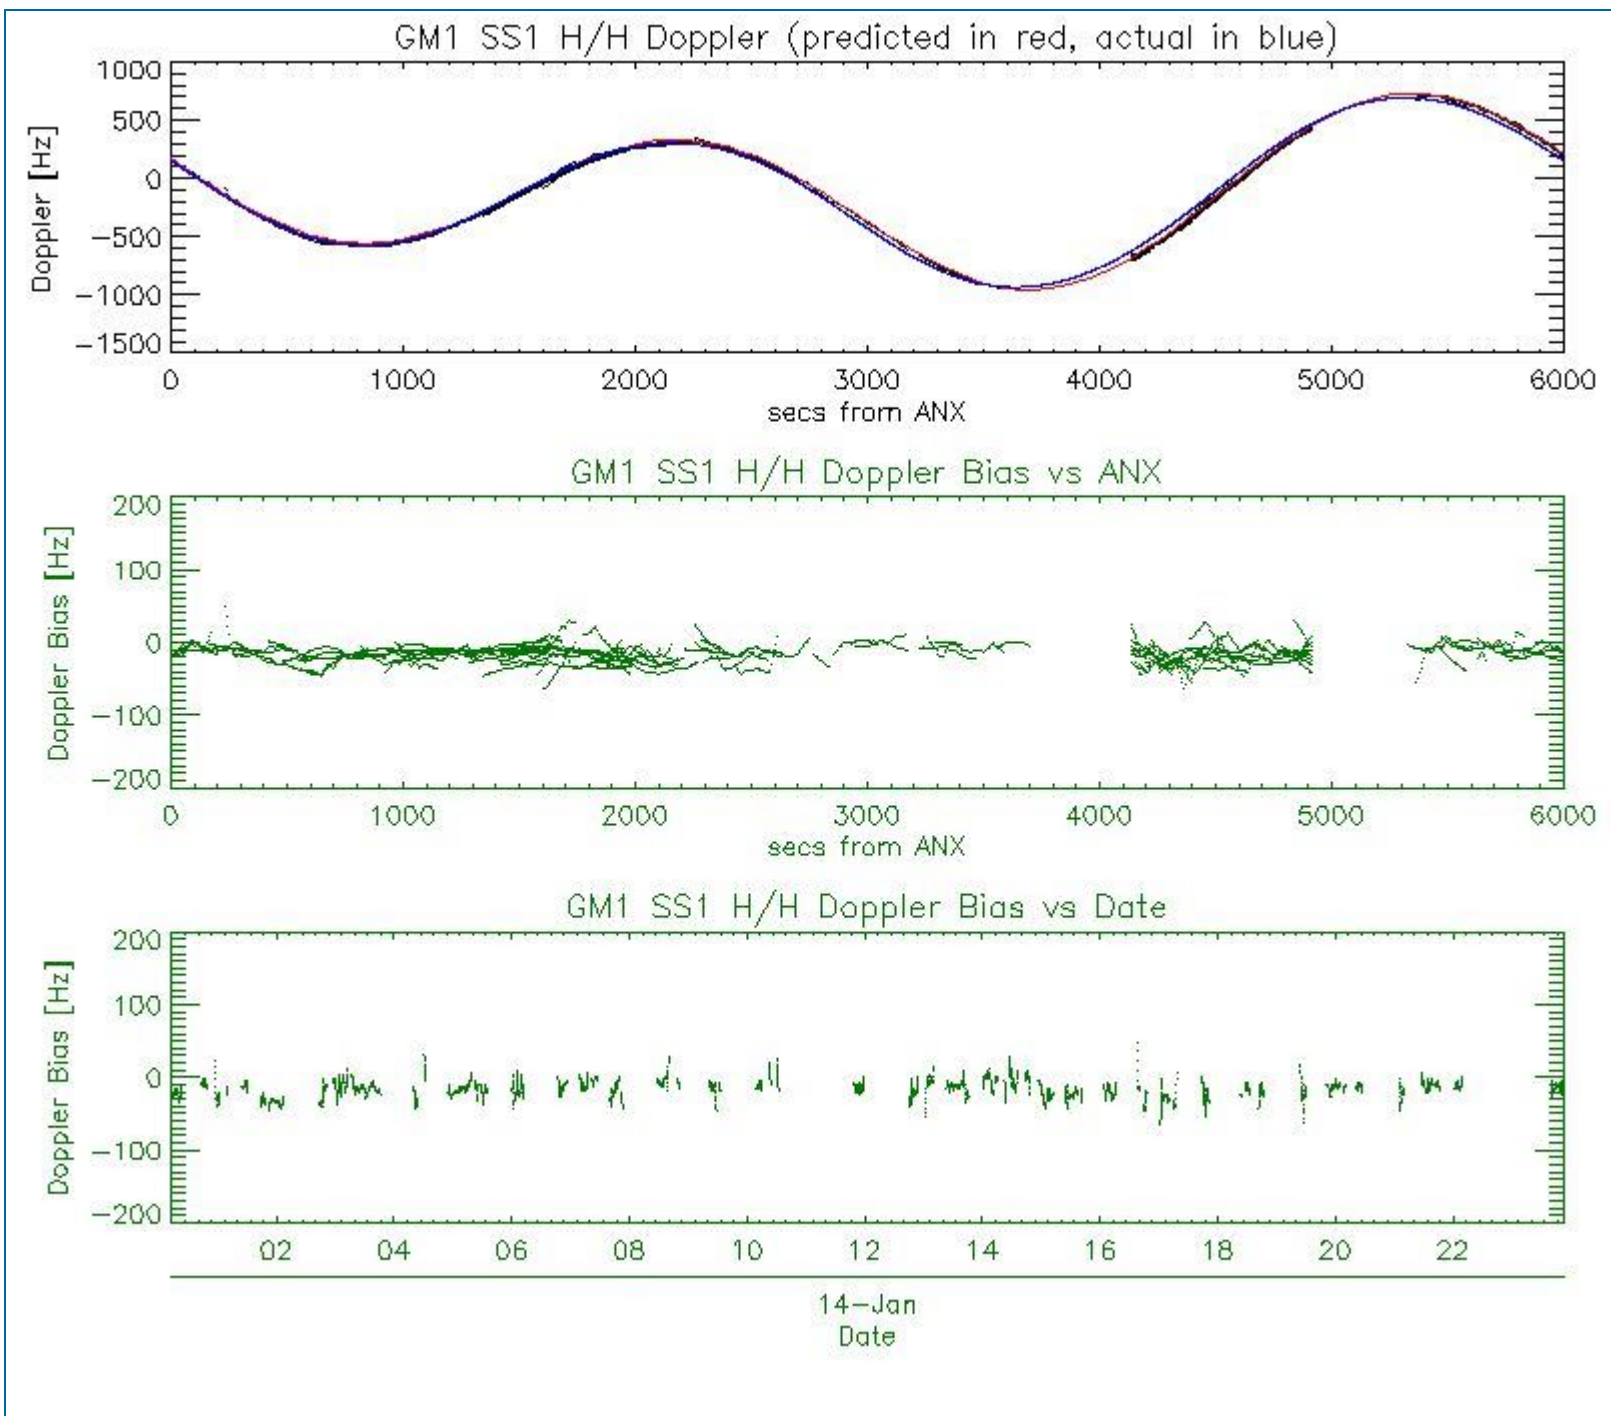

5.3 - Doppler JUMPS Analysis for WSM

[BACK TO MENU]



6 - CHIRP ANALYSIS

6.1 - Analysis for WSM SS1 H/H

6.1.1 - ScaleFactor

[BACK TO MENU]



6.2 - Analysis for WSM SS1 V/V

6.2.1 - ScaleFactor


[BACK TO MENU]



7 - RAW DATA ANALYSIS

7.1 - Analysis for WVS

[BACK TO MENU]

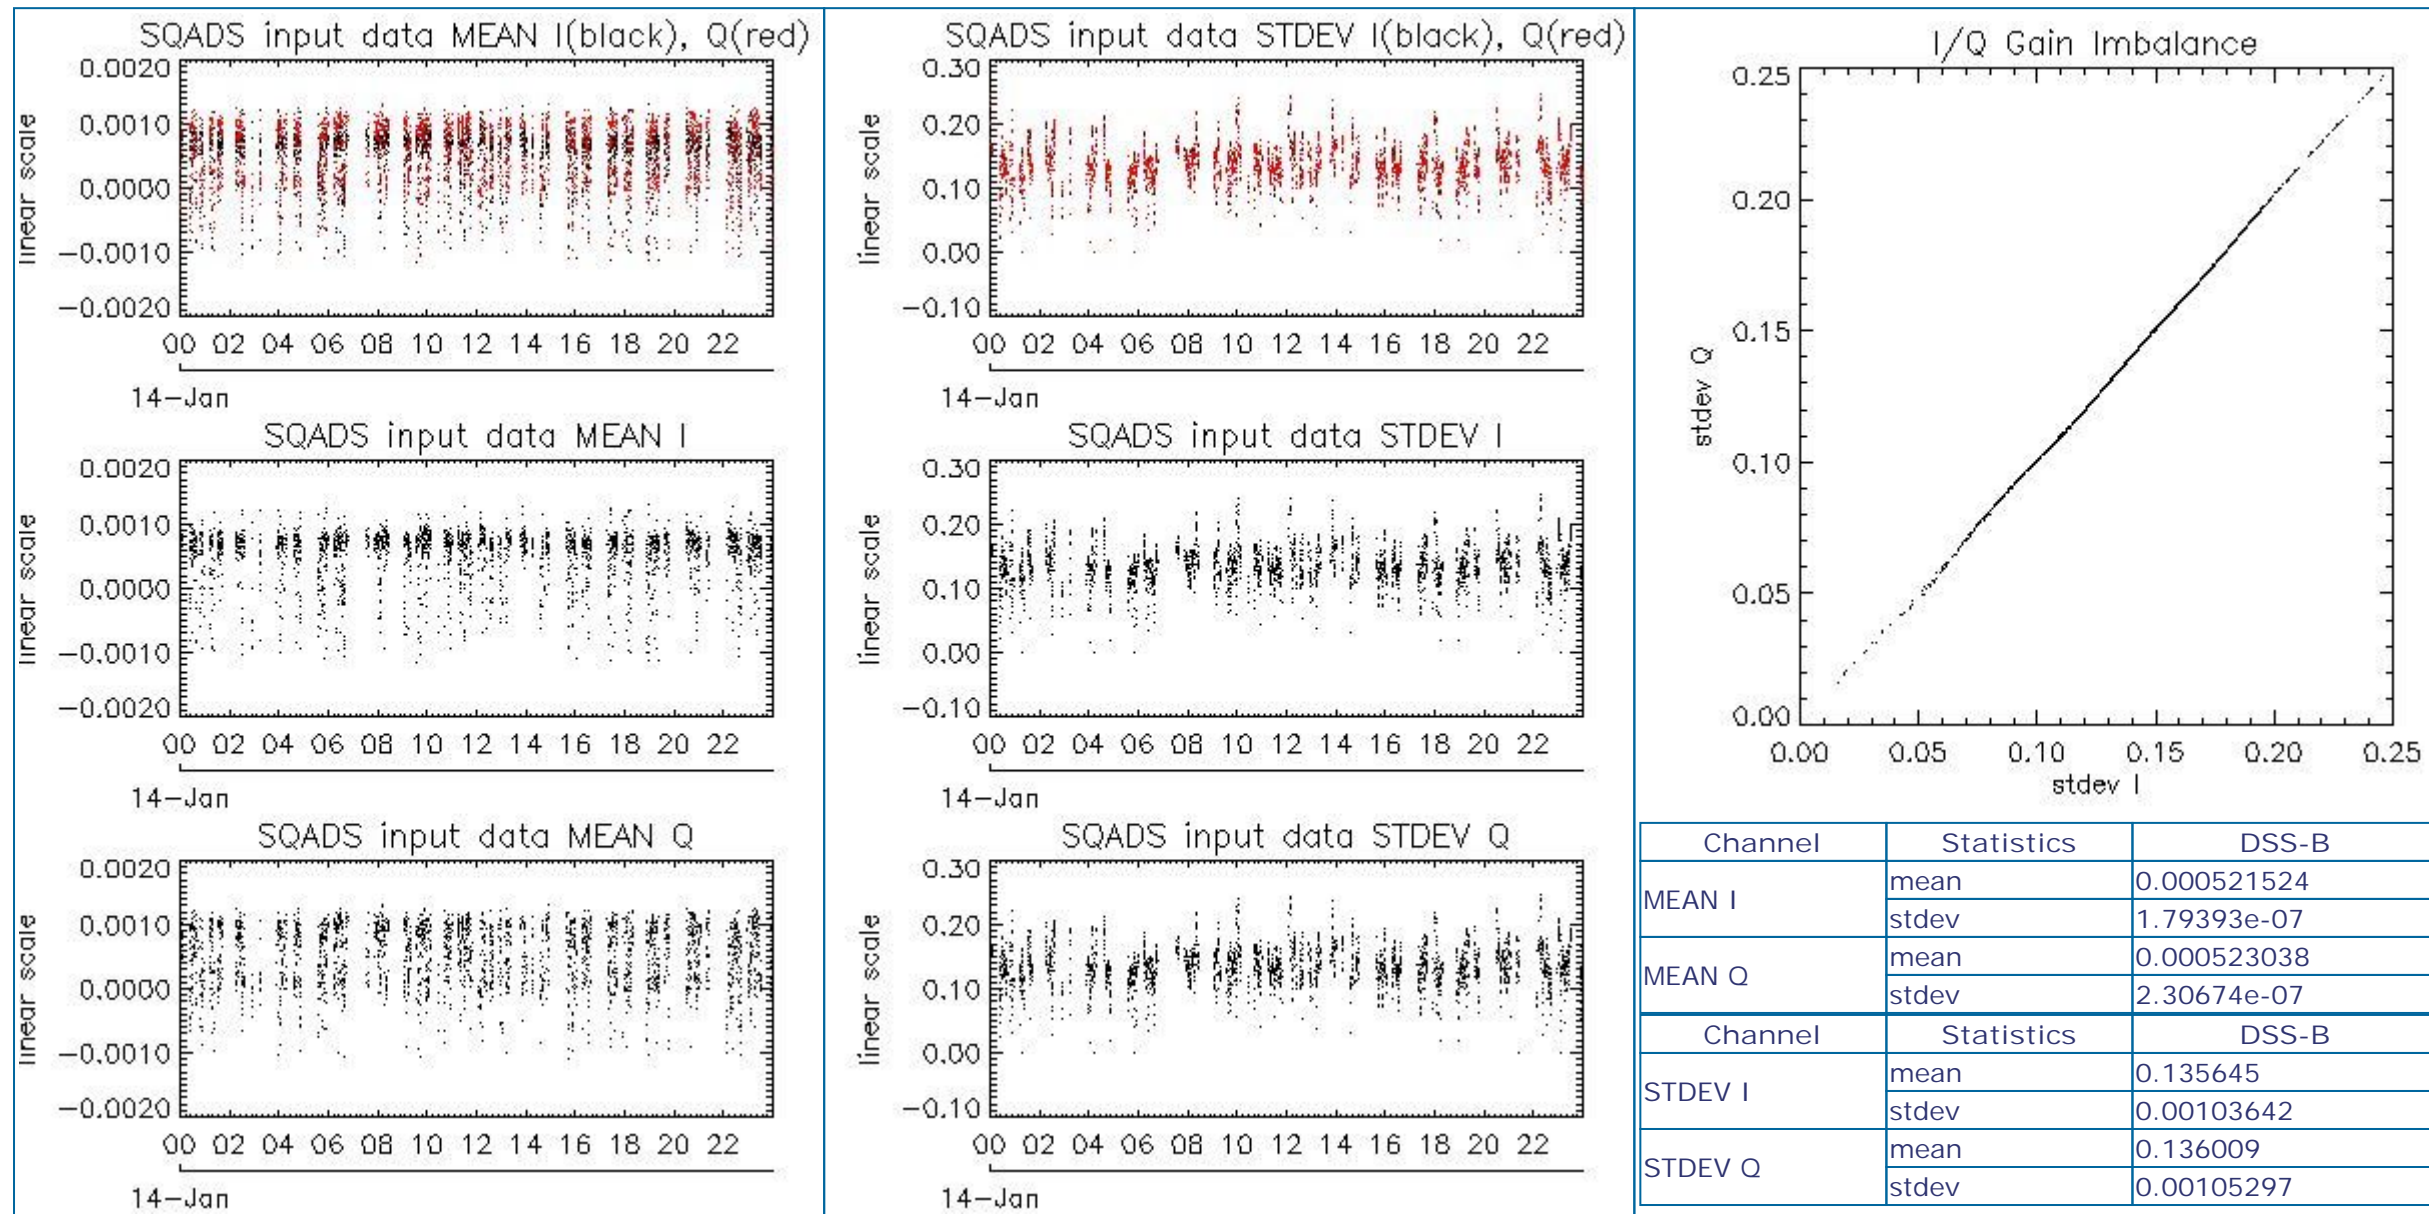

Channel	Statistics	DSS-B
MEAN I	mean	0.000521524
	stdev	1.79393e-07
MEAN Q	mean	0.000523038
	stdev	2.30674e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.135645
	stdev	0.00103642
STDEV Q	mean	0.136009
	stdev	0.00105297

7.2 - Analysis for IMM

[BACK TO MENU]

Channel	Statistics	DSS-B
MEAN I	mean	
	stdev	
MEAN Q	mean	
	stdev	
Channel	Statistics	DSS-B


STDEV I	mean	
	stdev	
STDEV Q	mean	
	stdev	

8 - TELEMETRY ANALYSIS

Processing Center	Product	Gaps	Missing lines
PDK	ASA_GM1_1PNPDK20090114_130644_000001992075_00324_35949_6845.N1	0	13


8.1 - Number of Missing lines

[[BACK TO MENU](#)]

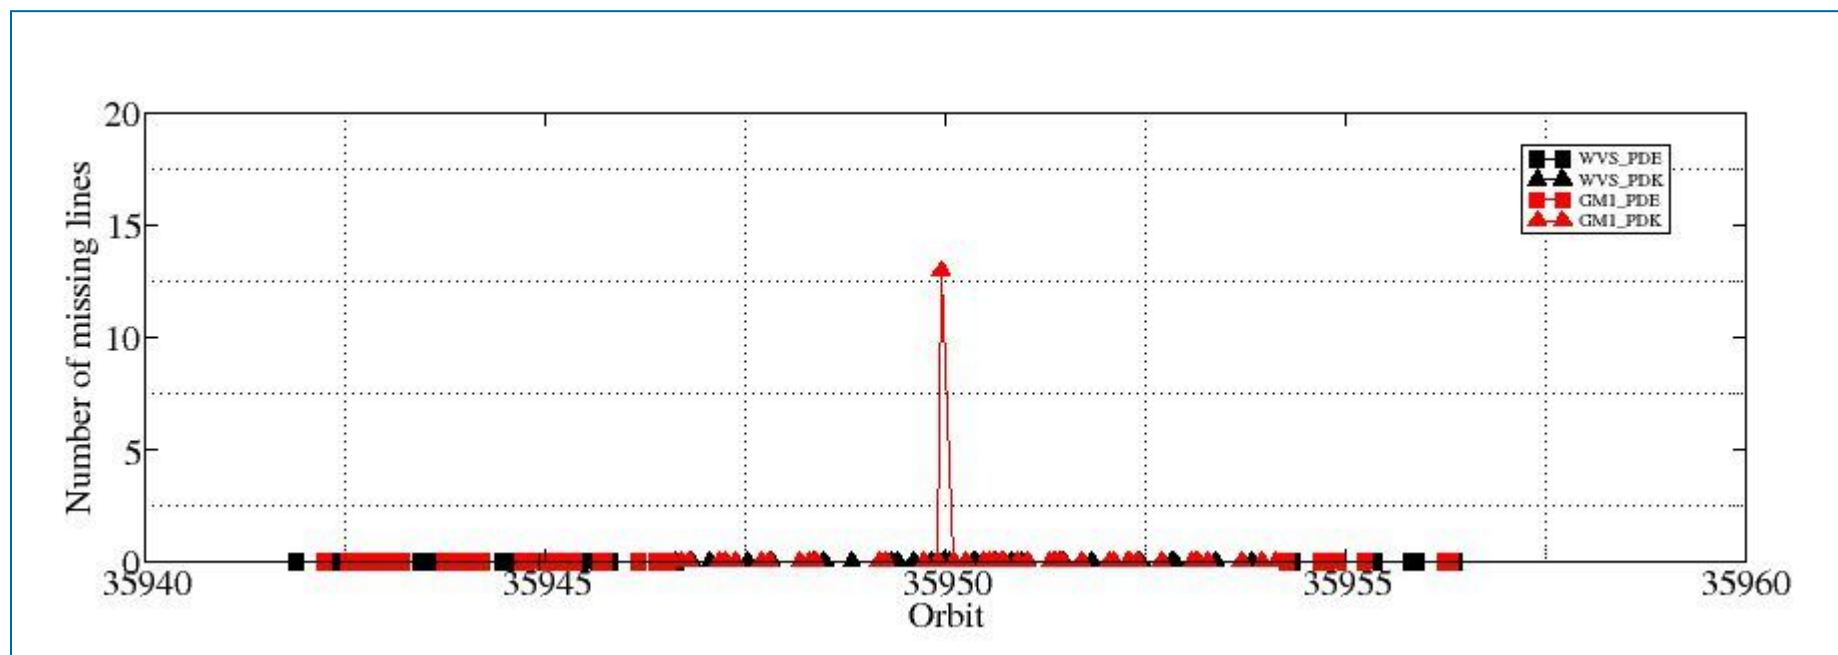

8.2 - Number of Gaps

[[BACK TO MENU](#)]

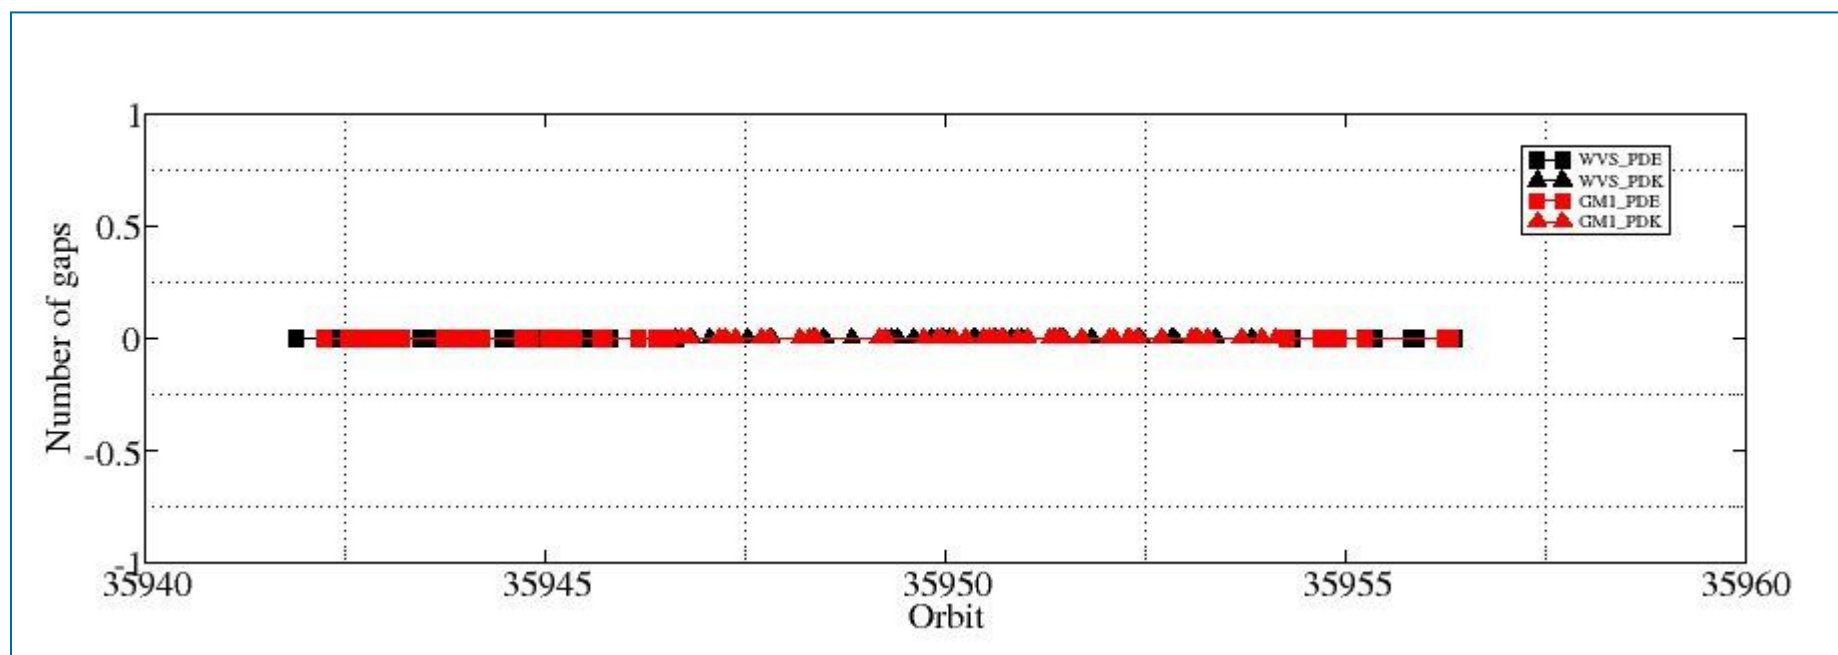

Document Reference: OSME-DPQC-SEDA-RP-06-0348/0349

Contract Reference: ESA/Esrin 19049/05/1-OL

All rights reserved to Serco S.p.A., Via XX Settembre, 1 - 00187 Roma - Italy.

In particular, but not limited to:

(a) Modification, reverse engineering or distribution is not permitted in any form.

(b) Usage is restricted to Serco S.p.A. employee belonging to the above Contract Reference.

Any deviation from above rules requires an explicit prior written authorisation of Serco S.p.A.

ASAR DAILY REPORT for 090114
#####

MODE: DAILY
ANALYSIS: ALL
DATE: YESTERDAY

Analysis will be performed from 2009-01-14 00:00:00 to 2009-01-14 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/090114/

DATA SUMMARY

Summary will be performed from 2009-01-14 00:00:00 to 2009-01-14 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/090114/DATA_SUMMARY

Creating directory ./RESULTS/DAILY/090114/DATA_SUMMARY...
Writing file ./RESULTS/DAILY/090114/DATA_SUMMARY/Data_summary.html...

Getting WVS products list from 2009-01-14 00:00:00 to 2009-01-14 23:59:59...
Writing file ./RESULTS/DAILY/090114/DATA_SUMMARY/List_WVS_products_used.xls...
Writing file ./RESULTS/DAILY/090114/DATA_SUMMARY/List_WVS_products_used.txt...

Getting GM1 products list from 2009-01-14 00:00:00 to 2009-01-14 23:59:59...
Writing file ./RESULTS/DAILY/090114/DATA_SUMMARY/List_GM1_products_used.xls...
Writing file ./RESULTS/DAILY/090114/DATA_SUMMARY/List_GM1_products_used.txt...

Getting APM products list from 2009-01-14 00:00:00 to 2009-01-14 23:59:59...
Writing file ./RESULTS/DAILY/090114/DATA_SUMMARY/List_APM_products_used.xls...
Writing file ./RESULTS/DAILY/090114/DATA_SUMMARY/List_APM_products_used.txt...

Getting IMM products list from 2009-01-14 00:00:00 to 2009-01-14 23:59:59...
Writing file ./RESULTS/DAILY/090114/DATA_SUMMARY/List_IMM_products_used.xls...
Writing file ./RESULTS/DAILY/090114/DATA_SUMMARY/List_IMM_products_used.txt...

Getting WSM products list from 2009-01-14 00:00:00 to 2009-01-14 23:59:59...
Writing file ./RESULTS/DAILY/090114/DATA_SUMMARY/List_WSM_products_used.xls...
Writing file ./RESULTS/DAILY/090114/DATA_SUMMARY/List_WSM_products_used.txt...

Getting MS products list from 2009-01-14 00:00:00 to 2009-01-14 23:59:59...
Writing file ./RESULTS/DAILY/090114/DATA_SUMMARY/List_MS_products_used.xls...
Writing file ./RESULTS/DAILY/090114/DATA_SUMMARY/List_MS_products_used.txt...

DATA SUMMARY completed
#####

AUXILIARY FILES ANALYSIS

Analysis will be performed from 2009-01-14 00:00:00 to 2009-01-14 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/090114/AUXILIARY

Creating directory ./RESULTS/DAILY/090114/AUXILIARY...

Looking for the IECF operational ADFs list...



Found list 20090114_030001_current_3_IECF_ADFs.txt...
Extracting ADFs...

ASA_CON_AXVIEC20081215_141339_20070204_165113_20091231_000000
ASA_INS_AXVIEC20081215_140905_20070307_060000_20091231_000000
ASA_XCH_AXVIEC20081215_143642_20020301_000000_20091231_000000
ASA_XCA_AXVIEC20081215_141741_20070204_165113_20091231_000000

Writing file ./RESULTS/DAILY/090114/AUXILIARY/ASAR_ADFs_IECF_List3.html...
Writing file ./RESULTS/DAILY/090114/AUXILIARY/Auxiliary_files_summary.html...

Analysing WVS products...

Writing file ./RESULTS/DAILY/090114/AUXILIARY/Check_ADFs_WVS.xls...
Writing file ./RESULTS/DAILY/090114/AUXILIARY/Check_ADFs_WVS.txt...

ASA_WVS_1PNPDE20090114_002235_000011472075_00317_35942_6119.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_004835_000004952075_00317_35942_6116.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_011040_000004492075_00317_35942_6132.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_011726_000002692075_00317_35942_6257.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_013011_000007492075_00318_35943_6264.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_021349_000004042075_00318_35943_6269.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_022207_000006892075_00318_35943_6272.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_023322_000002252075_00318_35943_6407.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_025525_000001052075_00318_35943_6420.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_031251_000001942075_00319_35944_6436.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_035500_000009892075_00319_35944_6439.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_041059_000000902075_00319_35944_6570.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_041548_000001202075_00319_35944_6573.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_043513_000011392075_00319_35944_6614.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_053424_000010192075_00320_35945_6625.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_055108_000004502075_00320_35945_6739.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_061228_000020392075_00320_35945_6804.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_073344_000000452075_00321_35946_6801.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_203000_000020392075_00329_35954_7255.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_211827_000002842075_00329_35954_7265.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_212227_000001502075_00329_35954_7390.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_220849_000001202075_00330_35955_7397.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_221244_000018892075_00330_35955_7400.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_225823_000004642075_00330_35955_7410.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_230508_000016492075_00330_35955_7535.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090114_235308_000009892075_00331_35956_7538.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_073414_000002102075_00321_35946_6476.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_075304_000013792075_00321_35946_6481.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_081739_000005692075_00322_35947_6491.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_090310_000010042075_00322_35947_6577.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_093340_000020842075_00322_35947_6587.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_100840_000000002075_00322_35947_6590.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_102621_000000602075_00323_35948_6703.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_104054_000011542075_00323_35948_6706.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_111412_000020542075_00323_35948_6716.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_120622_000002852075_00324_35949_6819.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_121323_000005692075_00324_35949_6828.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_123142_000005702075_00324_35949_6837.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_125452_000004052075_00324_35949_6840.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_131006_000005092075_00324_35949_6843.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_131939_000001642075_00325_35950_6854.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_134827_000000452075_00325_35950_6981.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_135041_000005842075_00325_35950_6990.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_141512_000001652075_00325_35950_6997.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_143528_000004802075_00325_35950_7000.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_144759_000004792075_00325_35950_7007.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_153659_000001492075_00326_35951_7129.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_154129_000012442075_00326_35951_7136.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_161604_000013042075_00326_35951_7145.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

```
ASA_WVS_1PNPDK20090114_171818_000014692075_00327_35952_7265.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_175636_000001202075_00327_35952_7262.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_180043_000011092075_00327_35952_7279.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_185226_000018592075_00328_35953_7390.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090114_193711_000006902075_00328_35953_7409.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

Analysing GM1 products...

Writing file ./RESULTS/DAILY/090114/AUXILIARY/Check_ADFs_GM1.xls...

Writing file ./RESULTS/DAILY/090114/AUXILIARY/Check_ADFs_GM1.txt...

```
ASA_GM1_1PNPDE20090114_001223_000006102075_00317_35942_6107.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_004225_000003682075_00317_35942_6109.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_005739_000002412075_00317_35942_6111.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_010917_000000782075_00317_35942_6129.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_012356_000003742075_00317_35942_6259.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_014442_000002232075_00318_35943_6266.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_015139_000009302075_00318_35943_6279.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_024325_000004712075_00318_35943_6409.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_025800_000001202075_00318_35943_6428.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_030007_000001322075_00318_35943_6426.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_030305_000002772075_00318_35943_6424.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_030911_000002172075_00318_35943_6422.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_031650_000008152075_00319_35944_7111.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_033116_000009302075_00319_35944_6461.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_042001_000001992075_00319_35944_6575.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_043029_000000782075_00319_35944_6577.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_045501_000006522075_00320_35945_6581.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_050710_000006762075_00320_35945_6583.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_052201_000002112075_00320_35945_6587.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_052718_000004222075_00320_35945_6621.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_055927_000002112075_00320_35945_6736.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_060437_000004712075_00320_35945_6759.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_064712_000006222075_00321_35946_6796.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_070909_000004712075_00321_35946_6792.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_072013_000001022075_00321_35946_6785.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_072244_000000782075_00321_35946_6794.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_072557_000001142075_00321_35946_6798.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_202103_000004042075_00329_35954_7252.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_210450_000001502075_00329_35954_7250.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_210902_000000782075_00329_35954_7262.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_212701_000011722075_00329_35954_7412.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_220040_000004892075_00330_35955_7407.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_233954_000003922075_00331_35956_7530.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20090114_234908_000002352075_00331_35956_7532.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_074003_000005432075_00321_35946_6478.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_075144_000000782075_00321_35946_6483.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_082759_000006582075_00322_35947_6493.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_083741_000001872075_00322_35947_6563.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_084919_000001382075_00322_35947_6565.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_092039_000004832075_00322_35947_6567.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_093125_000001322075_00322_35947_6569.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_100919_000003742075_00323_35948_6579.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_102152_000001752075_00323_35948_6700.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_102952_000001442075_00323_35948_6708.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_114917_000005372075_00324_35949_6718.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_115712_000000902075_00324_35949_6830.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_124514_000005732075_00324_35949_6834.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_130216_000002772075_00324_35949_6832.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_130644_000001992075_00324_35949_6845.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_132306_000010392075_00325_35950_6927.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_133910_000004412075_00325_35950_6983.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_140102_000003142075_00325_35950_6985.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_140742_000002172075_00325_35950_6987.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_141249_000001382075_00325_35950_6992.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```


ASA_GM1_1PNPDK20090114_142226_00000902075_00325_35950_6994.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_142638_000005252075_00325_35950_7002.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_144406_000002292075_00325_35950_7004.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_145644_000009302075_00326_35951_7014.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_152436_000001502075_00326_35951_7126.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_152807_000001442075_00326_35951_7124.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_153211_000002832075_00326_35951_7131.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_154007_00000782075_00326_35951_7133.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_160302_000007792075_00326_35951_7140.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_163831_000001572075_00327_35952_7138.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_164403_000002772075_00327_35952_7142.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_170126_000001382075_00327_35952_7255.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_170432_000003922075_00327_35952_7257.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_171502_000001932075_00327_35952_7259.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_174338_000004342075_00327_35952_7267.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_182317_000001022075_00328_35953_7269.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_182856_000001872075_00328_35953_7271.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_183044_00000782075_00328_35953_7383.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_184136_000003442075_00328_35953_7385.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_192414_000003862075_00328_35953_7387.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_195057_000008272075_00328_35953_7392.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20090114_200828_000001382075_00329_35954_7416.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing APM products...

No APM products available for the selected period...

Analysing IMM products...

No IMM products available for the selected period...

Analysing WSM products...

No WSM products available for the selected period...

AUXILIARY FILES ANALYSIS completed

#####

MODULE STEPPING ANALYSIS

#####

Analysis will be performed from 2009-01-14 00:00:00 to 2009-01-14 23:59:59

Results will be exported to the directory: ./RESULTS/DAILY/090114/MODULE_STEPPING

Creating directory ./RESULTS/DAILY/090114/MODULE_STEPPING...

Creating directory ./RESULTS/DAILY/090114/MODULE_STEPPING/FIRST_REFERENCE...

Creating directory ./RESULTS/DAILY/090114/MODULE_STEPPING/SECOND_REFERENCE...

Creating directory ./RESULTS/DAILY/090114/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Deleting old files...

Creating images comparing with second reference...

Exporting results to the directory ././RESULTS/DAILY/090114/MODULE_STEPPING/SECOND_REFERENCE...

Polarization: H

Reference product: ASA_MS__0PNPDK20050922_062651_00000152041_00034_18625_0041.N1

Test product: ASA_MS__0PNPDK20090113_081007_00000162075_00307_35932_0721.N1



H
H
../RESULTS/DAILY/090114/MODULE_STEPPING/SECOND_REFERENCE/TGH_20090113_081007-20050922_062651.png
../RESULTS/DAILY/090114/MODULE_STEPPING/SECOND_REFERENCE/TPH_20090113_081007-20050922_062651.png
../RESULTS/DAILY/090114/MODULE_STEPPING/SECOND_REFERENCE/RGH_20090113_081007-20050922_062651.png
../RESULTS/DAILY/090114/MODULE_STEPPING/SECOND_REFERENCE/RPH_20090113_081007-20050922_062651.png

Polarization: V
Reference product: ASA_MS__0PNPK20050923_055514_00000152041_00048_18639_0042.N1
Test product: ASA_MS__0PNPK20090114_073829_00000162075_00321_35946_0722.N1

V
V
../RESULTS/DAILY/090114/MODULE_STEPPING/SECOND_REFERENCE/TGV_20090114_073829-20050923_055514.png
../RESULTS/DAILY/090114/MODULE_STEPPING/SECOND_REFERENCE/TPV_20090114_073829-20050923_055514.png
../RESULTS/DAILY/090114/MODULE_STEPPING/SECOND_REFERENCE/RGV_20090114_073829-20050923_055514.png
../RESULTS/DAILY/090114/MODULE_STEPPING/SECOND_REFERENCE/RPV_20090114_073829-20050923_055514.png

Creating images comparing with previous product reference...

Exporting results to the directory ../RESULTS/DAILY/090114/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Polarization: H
Reference product: ASA_MS__0PNPDE20090112_015920_00000162075_00289_35914_0377.N1
Test product: ASA_MS__0PNPK20090113_081007_00000162075_00307_35932_0721.N1

H
H
../RESULTS/DAILY/090114/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGH_20090113_081007-20090112_015920.png
../RESULTS/DAILY/090114/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPH_20090113_081007-20090112_015920.png
../RESULTS/DAILY/090114/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGH_20090113_081007-20090112_015920.png
../RESULTS/DAILY/090114/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPH_20090113_081007-20090112_015920.png

Polarization: V
Reference product: ASA_MS__0PNPK20090112_084144_00000162075_00293_35918_0720.N1
Test product: ASA_MS__0PNPK20090114_073829_00000162075_00321_35946_0722.N1

V
V
../RESULTS/DAILY/090114/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGV_20090114_073829-20090112_084144.png
../RESULTS/DAILY/090114/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPV_20090114_073829-20090112_084144.png
../RESULTS/DAILY/090114/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGV_20090114_073829-20090112_084144.png
../RESULTS/DAILY/090114/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPV_20090114_073829-20090112_084144.png

MODULE_STEPPING ANALYSIS completed
#####

CALIBRATION PULSES ANALYSIS

Creating directory ./RESULTS/DAILY/090114/CALIBRATION_PULSES...

ALL ROWS Analysis will be performed from 2009-01-14 00:00:00 to 2009-01-14 23:59:59

Analysing products WVS IS2 V/V
Writing image ../RESULTS/DAILY/090114//CALIBRATION_PULSES/Calibration_pulses_all_rows_WVS_IS2_VV.png...
Analysing products GM1 SS3 H/H
Writing image ../RESULTS/DAILY/090114//CALIBRATION_PULSES/Calibration_pulses_all_rows_GM1_SS3_HH.png...

TEMPORAL EVOLUTION Analysis will be performed from 2009-01-14 00:00:00 to 2009-01-14 23:59:59



Analysing products WVS IS2 V/V
 Getting calibration pulses data for WVS IS2 V/V from 2009-01-14 00:00:00 to 2009-01-14 23:59:59. Rows: 1/5/9/13/17/21/25/29
 Writing file ./RESULTS/DAILY/090114/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-01-14_1.dat...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_1.png...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2009-01-14 00:00:00 to 2009-01-14 23:59:59. Rows: 2/6/10/14/18/22/26/30
 Writing file ./RESULTS/DAILY/090114/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-01-14_2.dat...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_2.png...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2009-01-14 00:00:00 to 2009-01-14 23:59:59. Rows: 3/7/11/15/19/23/27/31
 Writing file ./RESULTS/DAILY/090114/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-01-14_3.dat...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_3.png...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2009-01-14 00:00:00 to 2009-01-14 23:59:59. Rows: 4/8/12/16/20/24/28/32
 Writing file ./RESULTS/DAILY/090114/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-01-14_4.dat...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_4.png...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_4.png...

Analysing products GM1 SS3 H/H
 Getting calibration pulses data for GM1 SS3 H/H from 2009-01-14 00:00:00 to 2009-01-14 23:59:59. Rows: 1/5/9/13/17/21/25/29
 Writing file ./RESULTS/DAILY/090114/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-01-14_1.dat...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_1.png...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_1.png...

Getting calibration pulses data for GM1 SS3 H/H from 2009-01-14 00:00:00 to 2009-01-14 23:59:59. Rows: 2/6/10/14/18/22/26/30
 Writing file ./RESULTS/DAILY/090114/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-01-14_2.dat...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_2.png...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2009-01-14 00:00:00 to 2009-01-14 23:59:59. Rows: 3/7/11/15/19/23/27/31
 Writing file ./RESULTS/DAILY/090114/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-01-14_3.dat...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_3.png...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2009-01-14 00:00:00 to 2009-01-14 23:59:59. Rows: 4/8/12/16/20/24/28/32
 Writing file ./RESULTS/DAILY/090114/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-01-14_4.dat...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_4.png...
 Writing ../../RESULTS/DAILY/090114//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_4.png...

CALIBRATION PULSES ANALYSIS completed
 #####

DOPPLER ANALYSIS
 #####
 Creating directory ./RESULTS/DAILY/090114/DOPPLER...

 DOPPLER ANX Analysis will be performed from 2009-01-14 00:00:00 to 2009-01-14 23:59:59

Analysing products WVS IS2 V/V
 Getting doppler data for WVS IS2 V/V from 2009-01-14 00:00:00 to 2009-01-14 23:59:59...



Writing file ./RESULTS/DAILY/090114/DOPPLER/Doppler_data_WVS_IS2_VV_2009-01-14.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/090114/DOPPLER/DOPPLER_ANX_WVS_IS2_VV.png...

Analysing products GM1 SS1 H/H
Getting doppler data for GM1 SS1 H/H from 2009-01-14 00:00:00 to 2009-01-14 23:59:59...
Writing file ./RESULTS/DAILY/090114/DOPPLER/Doppler_data_GM1_SS1_HH_2009-01-14.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/090114/DOPPLER/DOPPLER_ANX_GM1_SS1_HH.png...

DOPPLER JUMPS Analysis will be performed on WSM products from 2009-01-14 00:00:00 to 2009-01-14 23:59:59

Analysing by default products WSM
Getting doppler jumps data for WSM from 2009-01-14 00:00:00 to 2009-01-14 23:59:59...
Writing file ./RESULTS/DAILY/090114/DOPPLER/Doppler_Jumps_data_WSM_2009-01-14.dat...
No data to be processed for WSM...

DOPPLER MAP Analysis will be performed from 2009-01-14 00:00:00 to 2009-01-14 23:59:59

Analysing products WVS IS2 V/V
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -24.275157 Hz
Writing file ../../RESULTS/DAILY/090114//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_desc.jpg...
Writing file ../../RESULTS/DAILY/090114//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_desc.jpg...

Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -24.058929 Hz
Writing file ../../RESULTS/DAILY/090114//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_asc.jpg...
Writing file ../../RESULTS/DAILY/090114//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_asc.jpg...

Analysing products GM1 SS1 H/H
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -17.184665 Hz
Writing file ../../RESULTS/DAILY/090114//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_desc.jpg...
Writing file ../../RESULTS/DAILY/090114//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_desc.jpg...

Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -15.525039 Hz
Writing file ../../RESULTS/DAILY/090114//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_asc.jpg...
Writing file ../../RESULTS/DAILY/090114//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_asc.jpg...

DOPPLER ANALYSIS completed
#####

CHIRP ANALYSIS

Creating directory ./RESULTS/DAILY/090114/CHIRP...

CHIRP Analysis will be performed from 2009-01-14 00:00:00 to 2009-01-14 23:59:59

Analysing products WSM SS1 H/H

Getting ScaleFactor data for WSM SS1 H/H from 2009-01-14 00:00:00 to 2009-01-14 23:59:59...
Writing file ./RESULTS/DAILY/090114/CHIRP/ScaleFactor_data_WSM_SS1_HH_2009-01-14.dat...
ScaleFactor: no data to be processed for WSM SS1 H/H...

Analysing products WSM SS1 V/V

Getting ScaleFactor data for WSM SS1 V/V from 2009-01-14 00:00:00 to 2009-01-14 23:59:59...
Writing file ./RESULTS/DAILY/090114/CHIRP/ScaleFactor_data_WSM_SS1_VV_2009-01-14.dat...
ScaleFactor: no data to be processed for WSM SS1 V/V...

CHIRP ANALYSIS completed
#####

RAW DATA ANALYSIS

Analysis will be performed from 2009-01-14 00:00:00 to 2009-01-14 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/090114/RAW_DATA

Creating directory ./RESULTS/DAILY/090114/RAW_DATA...

Getting raw data for WVS from 2009-01-14 00:00:00 to 2009-01-14 23:59:59...
Writing file ./RESULTS/DAILY/090114/RAW_DATA/Raw_data_WVS_2009-01-14.dat...
Running IDL program to create graphs...

Creating image ../RESULTS/DAILY/090114/RAW_DATA/Raw_data_WVS_input_mean.png...
Creating image ../RESULTS/DAILY/090114/RAW_DATA/Raw_data_WVS_input_stdev.png...
Creating image ../RESULTS/DAILY/090114/RAW_DATA/Raw_data_WVS_gain_imbalance.png...

Getting raw data for IMM from 2009-01-14 00:00:00 to 2009-01-14 23:59:59...
Writing file ./RESULTS/DAILY/090114/RAW_DATA/Raw_data_IMM_2009-01-14.dat...
No data to be processed for IMM...

RAW DATA ANALYSIS completed
#####

TELEMETRY ANALYSIS

Analysis will be performed from 2009-01-14 00:00:00 to 2009-01-14 23:59:59

Results will be exported to the directory: ./RESULTS/DAILY/090114/TELEMETRY

Creating directory ./RESULTS/DAILY/090114/TELEMETRY...

Looking for gaps and missing lines in WVS products...

Checking 27 products from PDE...

Checking 28 products from PDK...

Looking for gaps and missing lines in GM1 products...

Checking 34 products from PDE...

Checking 42 products from PDK...

Found product..ASA_GM1_1PNPDK20090114_130644_000001992075_00324_35949_6845.N1 / 0 gaps / 13 missing lines

Looking for gaps and missing lines in APM products...

No products from PDE...

No products from PDK...

Looking for gaps and missing lines in IMM products...

No products from PDE...

No products from PDK...

Looking for gaps and missing lines in WSM products...

No products from PDE...

No products from PDK...

Creating graph of missing lines and gaps...

Creating image: ./RESULTS/DAILY/090114/TELEMETRY/TELEMETRY_Missing_lines.png...

Creating image: ./RESULTS/DAILY/090114/TELEMETRY/TELEMETRY_Gaps.png...

TELEMETRY ANALYSIS completed

#####

BROWSE PRODUCTS ANALYSIS

#####

Analysis will be performed on 2009-01-14

Scanning directory /nas3/ENVISAT/ASAR//ASA_GM__BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_GM__BP/JPG/20090114/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM__BP/ASA_GM__BPZPDE20090114_031650_000008152075_00319_35944_7112.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM__BP/ASA_GM__BPZPDE20090114_202103_000004042075_00329_35954_7253.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM__BP/ASA_GM__BPZPDE20090114_210450_000001502075_00329_35954_7251.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM__BP/ASA_GM__BPZPDE20090114_210902_000000782075_00329_35954_7263.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM__BP/ASA_GM__BPZPDE20090114_212701_000011722075_00329_35954_7413.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM__BP/ASA_GM__BPZPDE20090114_220040_000004892075_00330_35955_7408.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM__BP/ASA_GM__BPZPDE20090114_233954_000003922075_00331_35956_7531.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM__BP/ASA_GM__BPZPDE20090114_234908_000002352075_00331_35956_7533.N1 ...

ANALYSIS COMPLETED: 8 GM browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_AP__BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_AP__BP/JPG/20090114/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_AP__BP/ASA_AP__BPZPDE20090114_134951_000000432075_00325_35950_7122.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_AP__BP/ASA_AP__BPZPDE20090114_152704_000000402075_00326_35951_7130.N1 ...

ANALYSIS COMPLETED: 2 AP browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_IM_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_IM_BP/JPG/20090114/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090114_122335_000004272075_00324_35949_7103.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090114_140614_000000772075_00325_35950_7128.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090114_170342_000000402075_00327_35952_7170.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090114_171101_000002292075_00327_35952_7190.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090114_182037_000000372075_00328_35953_7180.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090114_182657_000001092075_00328_35953_7247.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090114_184721_000002982075_00328_35953_7244.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090114_194924_000000822075_00328_35953_7230.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090114_202747_000001232075_00329_35954_7349.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090114_212528_000000832075_00329_35954_7351.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDE20090114_221134_000000632075_00330_35955_7482.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDK20090114_215745_000001632075_00330_35955_7537.N1 ...

ANALYSIS COMPLETED: 12 IM browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_WS_BP...

Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_WS_BP/JPG/20090114/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_085702_000003122075_00322_35947_6967.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_085815_000002392075_00322_35947_6943.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_101535_000000922075_00323_35948_6973.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_103434_000001342075_00323_35948_7065.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_103434_000003732075_00323_35948_7062.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_103434_000003732075_00323_35948_7081.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_103845_000001212075_00323_35948_7066.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_110051_000004152075_00323_35948_7079.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_110401_000000612075_00323_35948_7049.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_110704_000000422075_00323_35948_7055.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_134636_000001092075_00325_35950_7146.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_141835_000001352075_00325_35950_7156.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_142403_000001532075_00325_35950_7154.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_152242_000001092075_00326_35951_7164.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_164114_000001652075_00327_35952_7166.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_164843_000001522075_00327_35952_7168.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_175057_000001352075_00327_35952_7213.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_175057_000003362075_00327_35952_7268.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_175407_000001452075_00327_35952_7214.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_182141_000000912075_00328_35953_7208.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_182502_000000912075_00328_35953_7210.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_193045_000003732075_00328_35953_7249.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_210727_000000912075_00329_35954_7378.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_211024_000002512075_00329_35954_7388.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_211024_000004822075_00329_35954_7511.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_211536_000000612075_00329_35954_7372.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_211738_000000482075_00329_35954_7376.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_214941_000001902075_00330_35955_7386.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_224503_000002312075_00330_35955_7522.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_225003_000002502075_00330_35955_7525.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_225003_000004892075_00330_35955_7625.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_225717_000000552075_00330_35955_7509.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_233327_000001522075_00331_35956_7670.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDE20090114_234634_000001462075_00331_35956_7672.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDK20090114_201052_000006052075_00329_35954_7517.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDK20090114_215158_000000922075_00330_35955_7539.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDK20090114_215347_000002372075_00330_35955_7541.N1 ...

ANALYSIS COMPLETED: 37 WS browse products to see...

BROWSE PRODUCTS ANALYSIS completed
#####

HTML REPORT generation
#####

Building file ./RESULTS/DAILY/090114/asarReport.html...
Building DATA SUMMARY section...
Building AUXILIARY FILES ANALYSIS section...
Building MODULE STEPPING ANALYSIS section...
Building CALIBRATION PULSES ANALYSIS section...
Building DOPPLER ANALYSIS section...
Building CHIRP ANALYSIS section...
Building RAW DATA ANALYSIS section...
Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed
#####



ASAR Daily Report



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.


Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20090114_001223_000006102075_00317_35942_6107.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_004225_000003682075_00317_35942_6109.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_005739_000002412075_00317_35942_6111.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_010917_000000782075_00317_35942_6129.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_012356_000003742075_00317_35942_6259.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_014442_000002232075_00318_35943_6266.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_015139_000009302075_00318_35943_6279.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_024325_000004712075_00318_35943_6409.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_025800_000001202075_00318_35943_6428.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_030007_000001322075_00318_35943_6426.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_030305_000002772075_00318_35943_6424.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_030911_000002172075_00318_35943_6422.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_031650_000008152075_00319_35944_7111.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_033116_000009302075_00319_35944_6461.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_042001_000001992075_00319_35944_6575.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_043029_000000782075_00319_35944_6577.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_045501_000006522075_00320_35945_6581.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_050710_000006762075_00320_35945_6583.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_052201_000002112075_00320_35945_6587.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_052718_000004222075_00320_35945_6621.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_055927_000002112075_00320_35945_6736.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_060437_000004712075_00320_35945_6759.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_064712_000006222075_00321_35946_6796.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_070909_000004712075_00321_35946_6792.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_072013_000001022075_00321_35946_6785.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_072244_000000782075_00321_35946_6794.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_072557_000001142075_00321_35946_6798.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_202103_000004042075_00329_35954_7252.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_210450_000001502075_00329_35954_7250.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_210902_000000782075_00329_35954_7262.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_212701_000011722075_00329_35954_7412.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_220040_000004892075_00330_35955_7407.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_233954_000003922075_00331_35956_7530.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090114_234908_000002352075_00331_35956_7532.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_074003_000005432075_00321_35946_6478.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_075144_000000782075_00321_35946_6483.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_082759_000006582075_00322_35947_6493.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_083741_000001872075_00322_35947_6563.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_084919_000001382075_00322_35947_6565.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_092039_000004832075_00322_35947_6567.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_093125_000001322075_00322_35947_6569.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_100919_000003742075_00323_35948_6579.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_102152_000001752075_00323_35948_6700.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_102952_000001442075_00323_35948_6708.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_114917_000005372075_00324_35949_6718.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_115712_000000902075_00324_35949_6830.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_124514_000005732075_00324_35949_6834.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_130216_000002772075_00324_35949_6832.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_130644_000001992075_00324_35949_6845.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_132306_000010392075_00325_35950_6927.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_133910_000004412075_00325_35950_6983.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_140102_000003142075_00325_35950_6985.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_140742_000002172075_00325_35950_6987.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_141249_000001382075_00325_35950_6992.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_142226_000000902075_00325_35950_6994.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_142638_000005252075_00325_35950_7002.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_144406_000002292075_00325_35950_7004.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_145644_000009302075_00326_35951_7014.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_152436_000001502075_00326_35951_7126.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_152807_000001442075_00326_35951_7124.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_153211_000002832075_00326_35951_7131.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_154007_000000782075_00326_35951_7133.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_160302_000007792075_00326_35951_7140.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_163831_000001572075_00327_35952_7138.N1					OK	OK	OK	OK

ASA_GM1_1PNPDK20090114_164403_000002772075_00327_35952_7142.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_170126_000001382075_00327_35952_7255.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_170432_000003922075_00327_35952_7257.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_171502_000001932075_00327_35952_7259.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_174338_000004342075_00327_35952_7267.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_182317_000001022075_00328_35953_7269.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_182856_000001872075_00328_35953_7271.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_183044_000000782075_00328_35953_7383.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_184136_000003442075_00328_35953_7385.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_192414_000003862075_00328_35953_7387.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_195057_000008272075_00328_35953_7392.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20090114_200828_000001382075_00329_35954_7416.N1	OK	OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20090114_002235_000011472075_00317_35942_6119.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_004835_000004952075_00317_35942_6116.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_011040_000004492075_00317_35942_6132.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_011726_000002692075_00317_35942_6257.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_013011_000007492075_00318_35943_6264.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_021349_000004042075_00318_35943_6269.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_022207_000006892075_00318_35943_6272.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_023322_000002252075_00318_35943_6407.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_025525_000001052075_00318_35943_6420.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_031251_000001942075_00319_35944_6436.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_035500_000009892075_00319_35944_6439.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_041059_00000902075_00319_35944_6570.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_041548_000001202075_00319_35944_6573.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_043513_000011392075_00319_35944_6614.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_053424_000010192075_00320_35945_6625.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_055108_000004502075_00320_35945_6739.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_061228_000020392075_00320_35945_6804.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_073344_000000452075_00321_35946_6801.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_203000_000020392075_00329_35954_7255.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_211827_000002842075_00329_35954_7265.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_212227_000001502075_00329_35954_7390.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_220849_000001202075_00330_35955_7397.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_221244_000018892075_00330_35955_7400.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_225823_000004642075_00330_35955_7410.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_230508_000016492075_00330_35955_7535.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090114_235308_000009892075_00331_35956_7538.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_073414_000002102075_00321_35946_6476.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_075304_000013792075_00321_35946_6481.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_081739_000005692075_00322_35947_6491.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_090310_000010042075_00322_35947_6577.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_093340_000020842075_00322_35947_6587.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_100840_000000002075_00322_35947_6590.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_102621_000000602075_00323_35948_6703.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_104054_000011542075_00323_35948_6706.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_111412_000020542075_00323_35948_6716.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_120622_000002852075_00324_35949_6819.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_121323_000005692075_00324_35949_6828.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_123142_000005702075_00324_35949_6837.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_125452_000004052075_00324_35949_6840.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_131006_000005092075_00324_35949_6843.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_131939_000001642075_00325_35950_6854.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_134827_000000452075_00325_35950_6981.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_135041_000005842075_00325_35950_6990.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_141512_000001652075_00325_35950_6997.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_143528_000004802075_00325_35950_7000.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_144759_000004792075_00325_35950_7007.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_153659_000001492075_00326_35951_7129.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_154129_000012442075_00326_35951_7136.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_161604_000013042075_00326_35951_7145.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_171818_000014692075_00327_35952_7265.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_175636_000001202075_00327_35952_7262.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_180043_000011092075_00327_35952_7279.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_185226_000018592075_00328_35953_7390.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090114_193711_000006902075_00328_35953_7409.N1					OK	OK	OK	OK


Calibration pulses for GM1 SS3 H/H

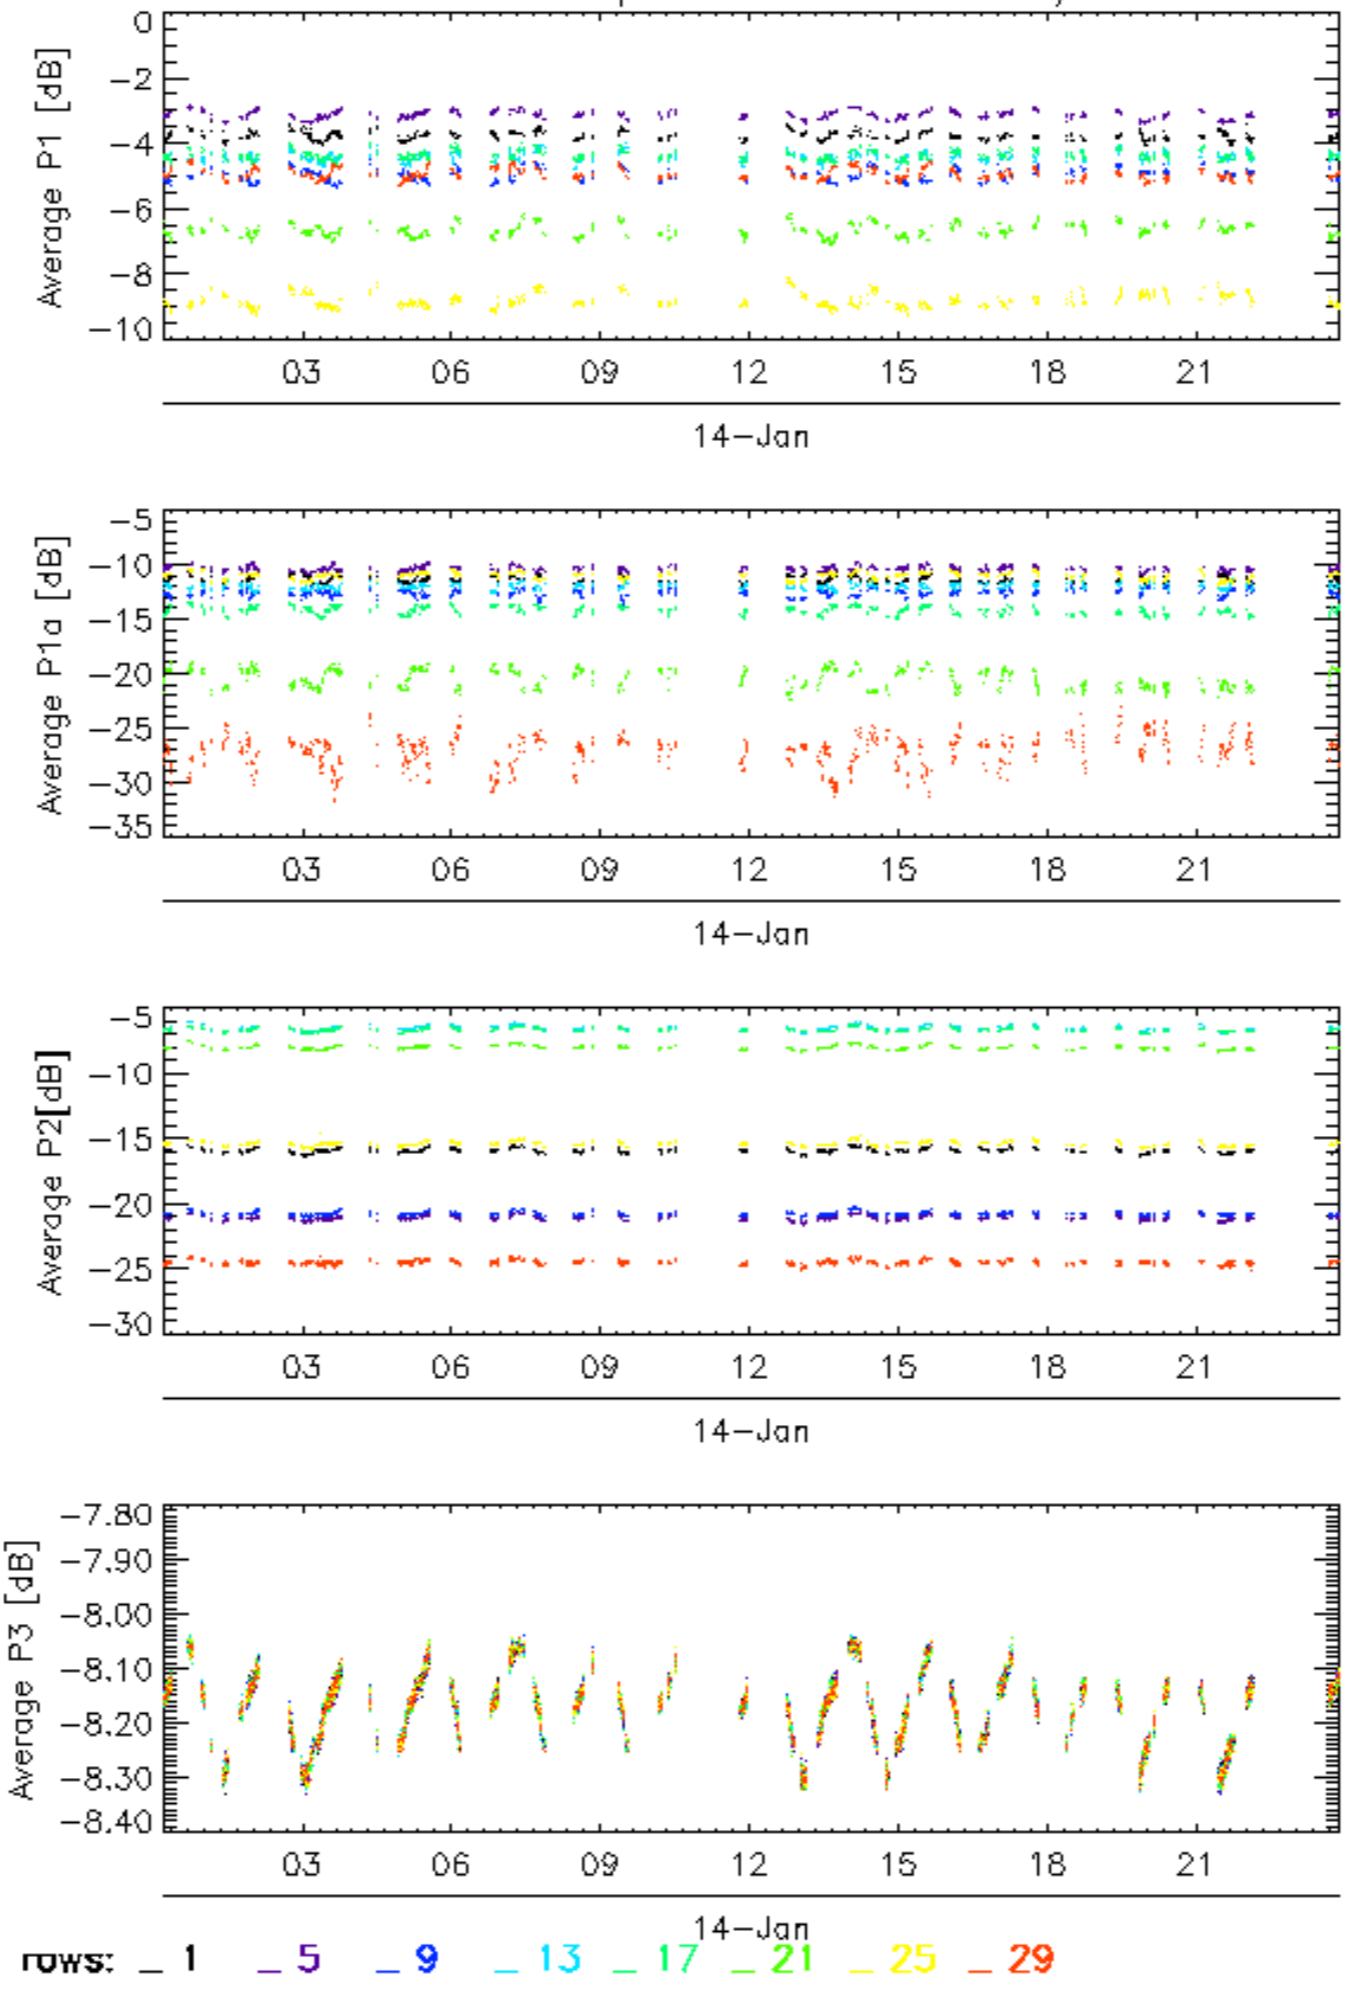


Calibration pulses for GM1 SS3 H/H

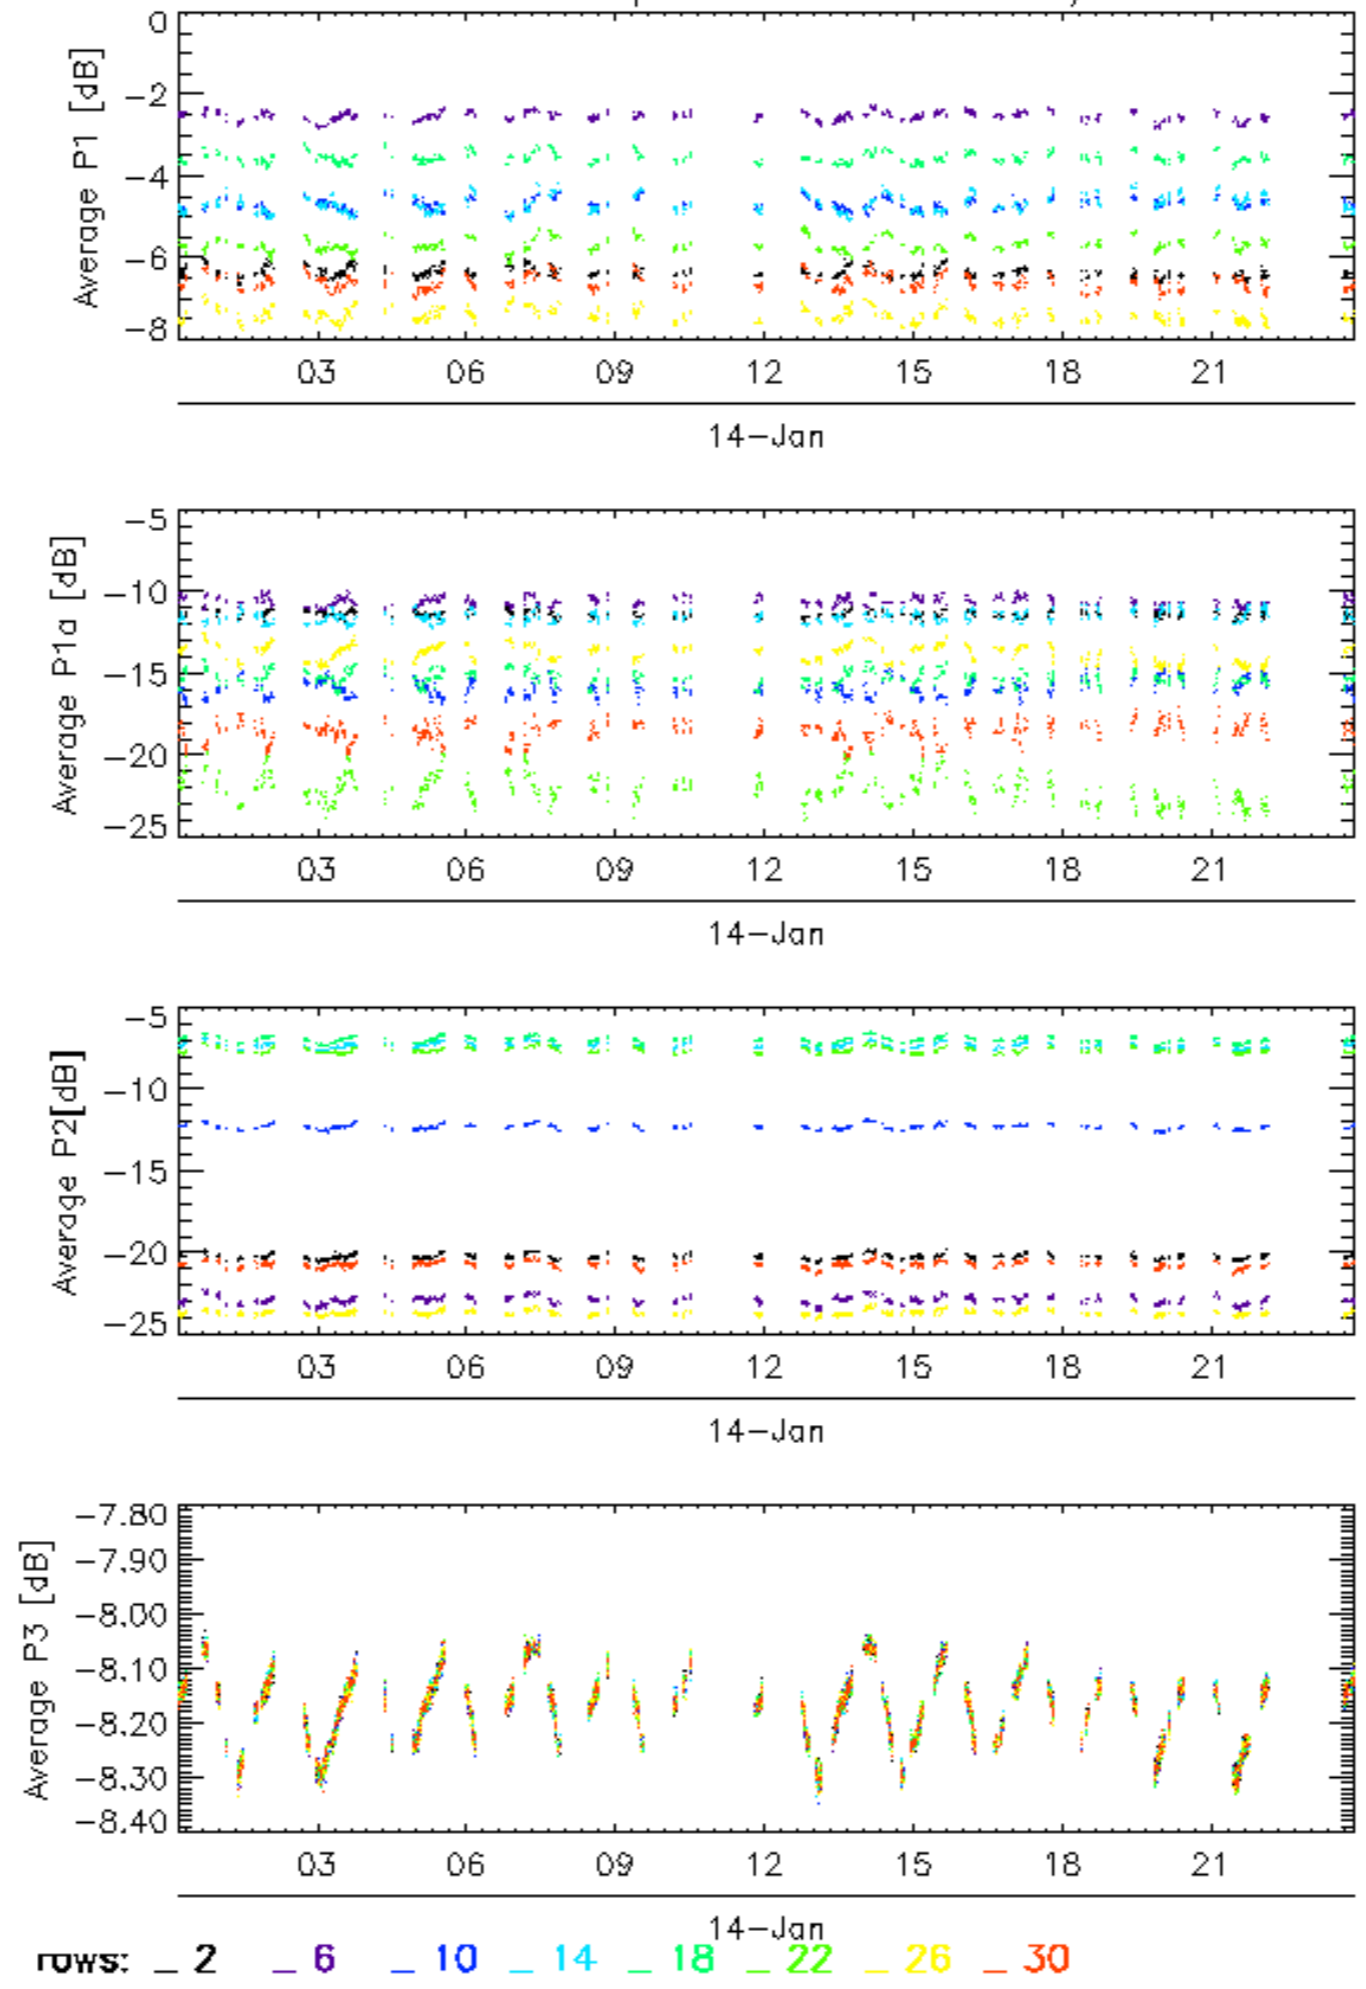


Calibration pulses for GM1 SS3 H/H

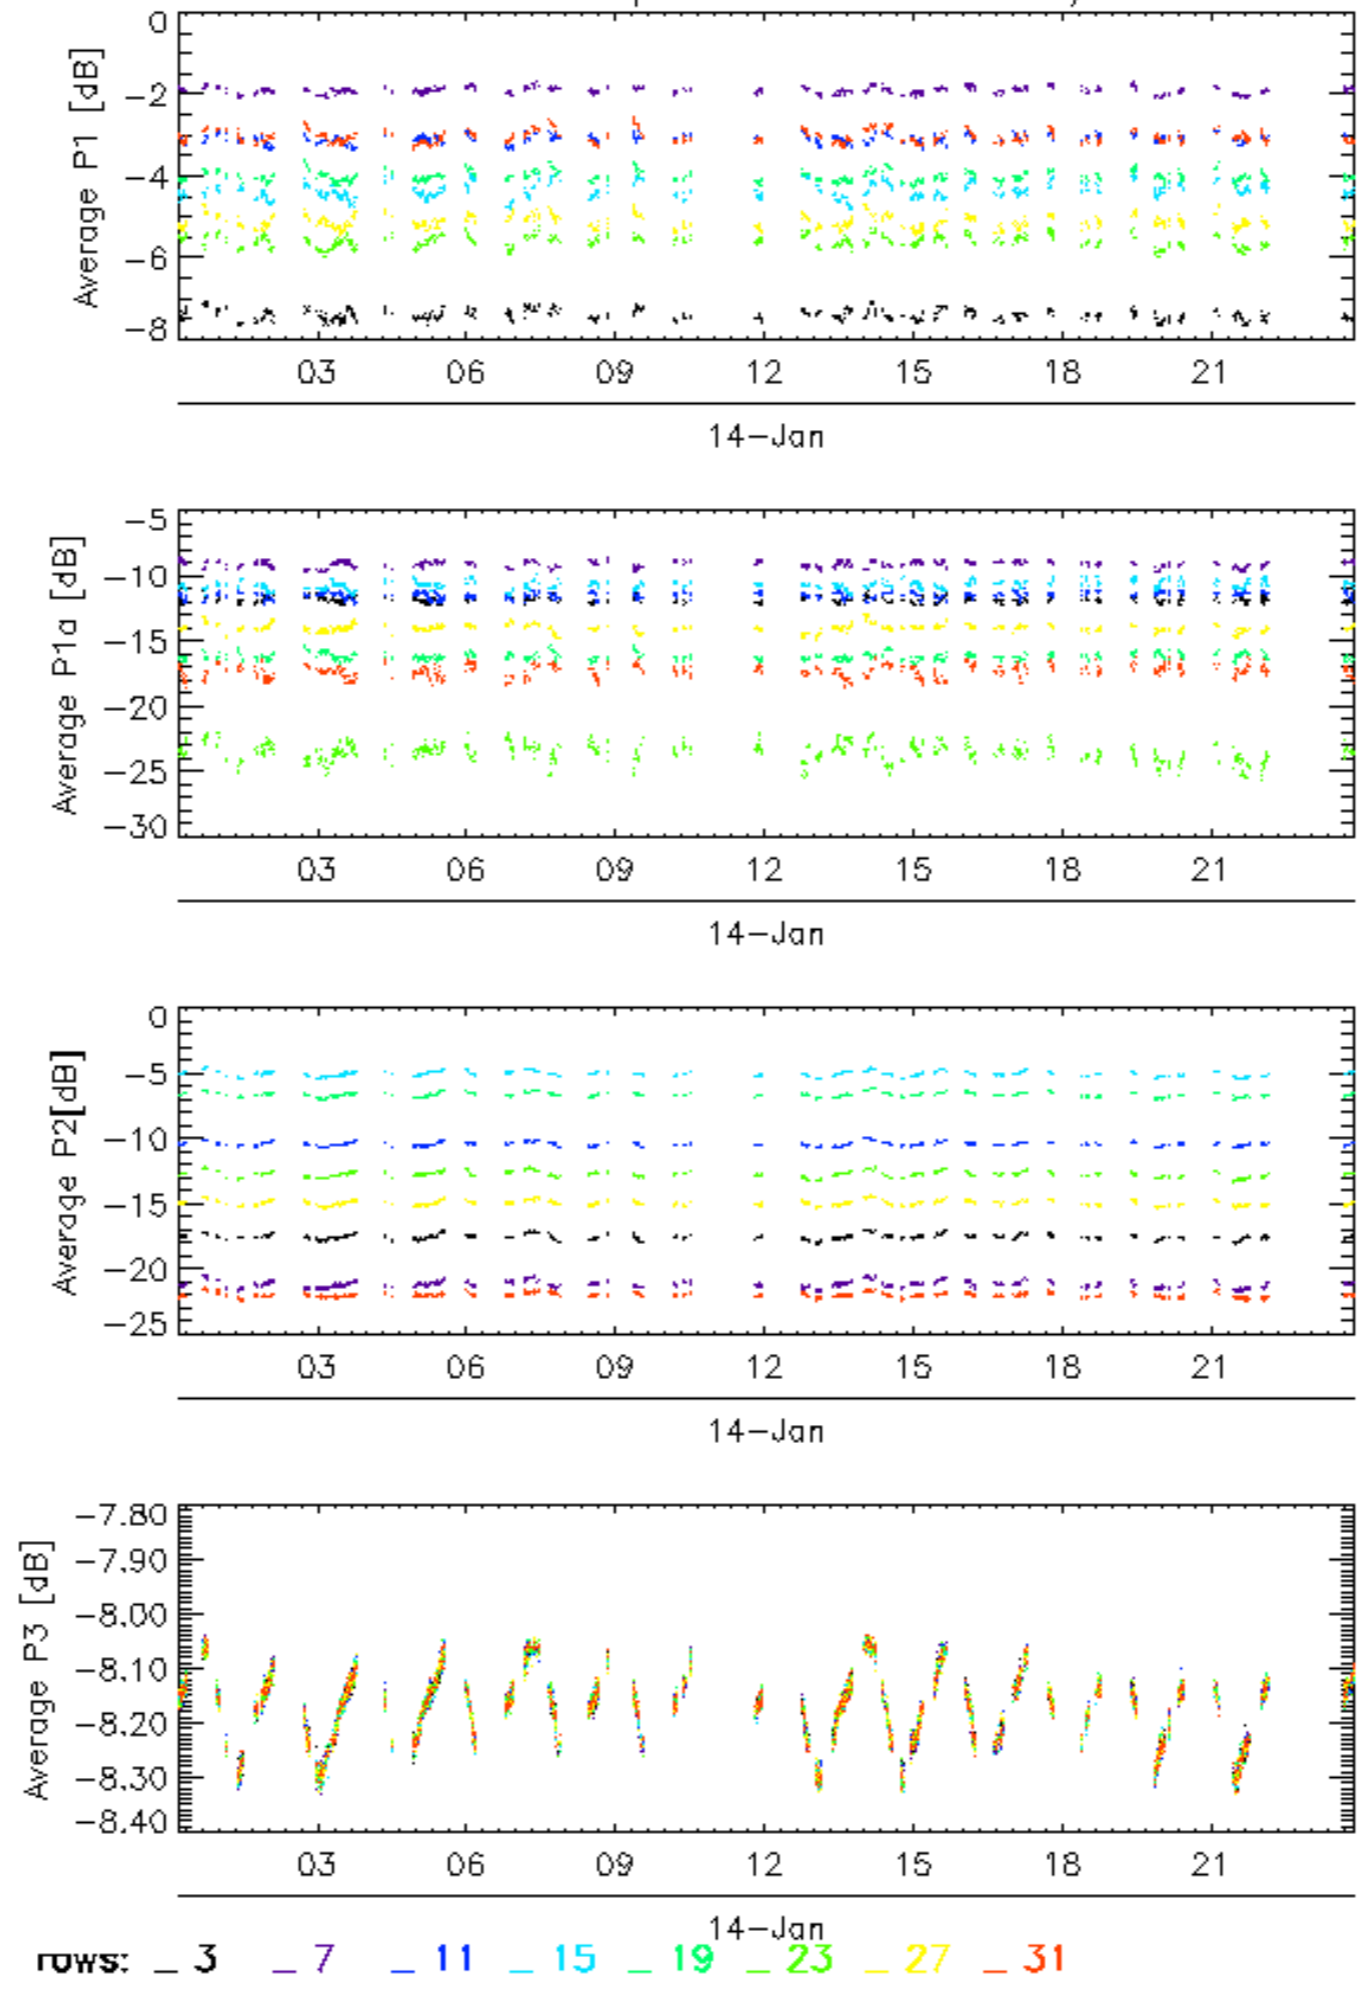


Calibration pulses for GM1 SS3 H/H

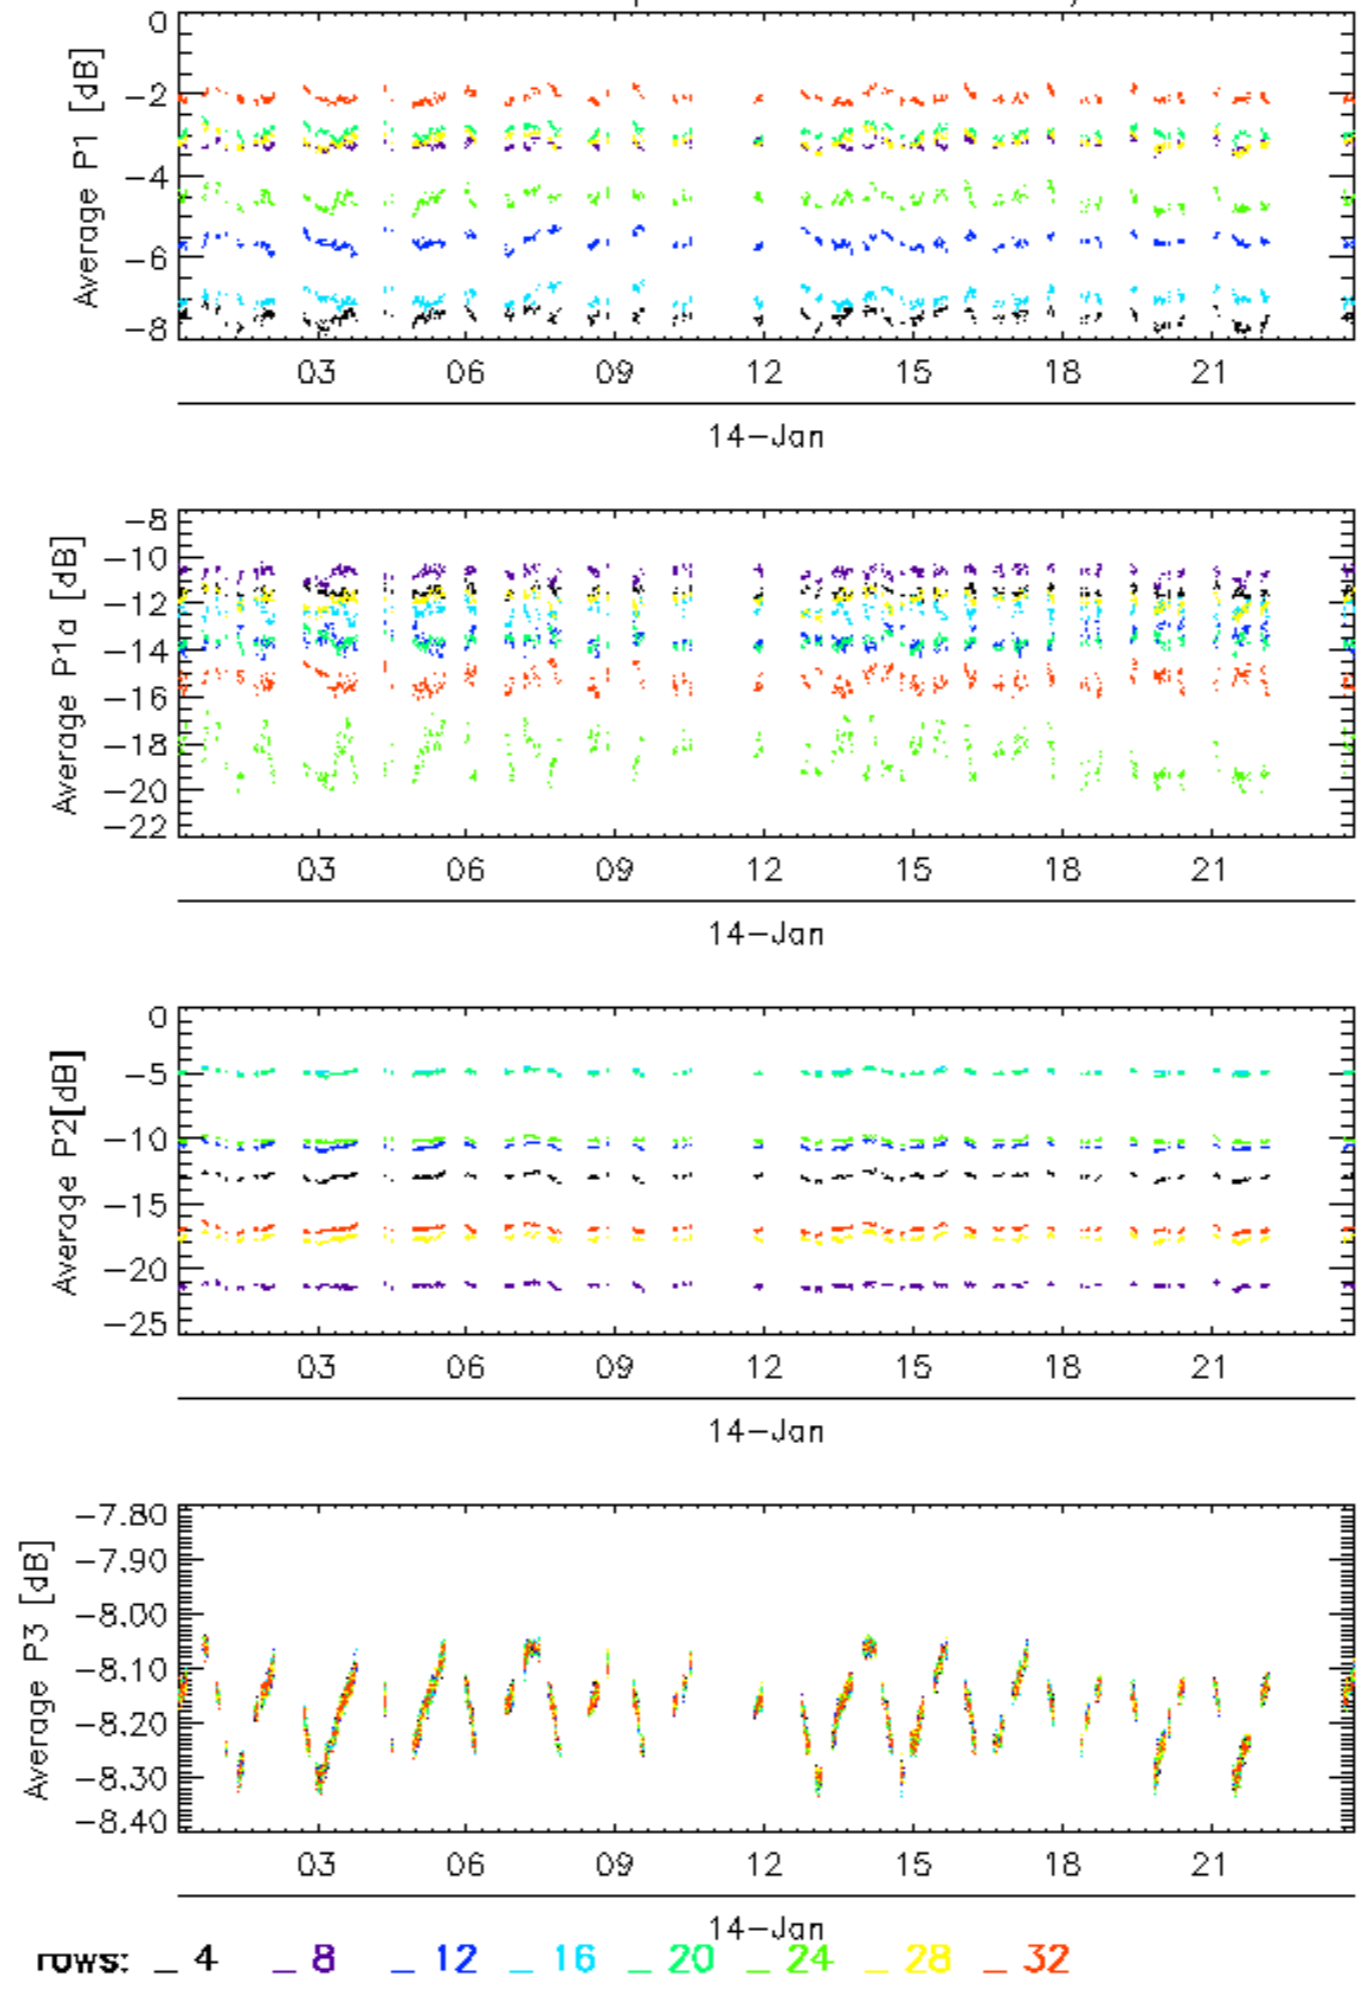


Calibration pulses for WVS IS2 V/V

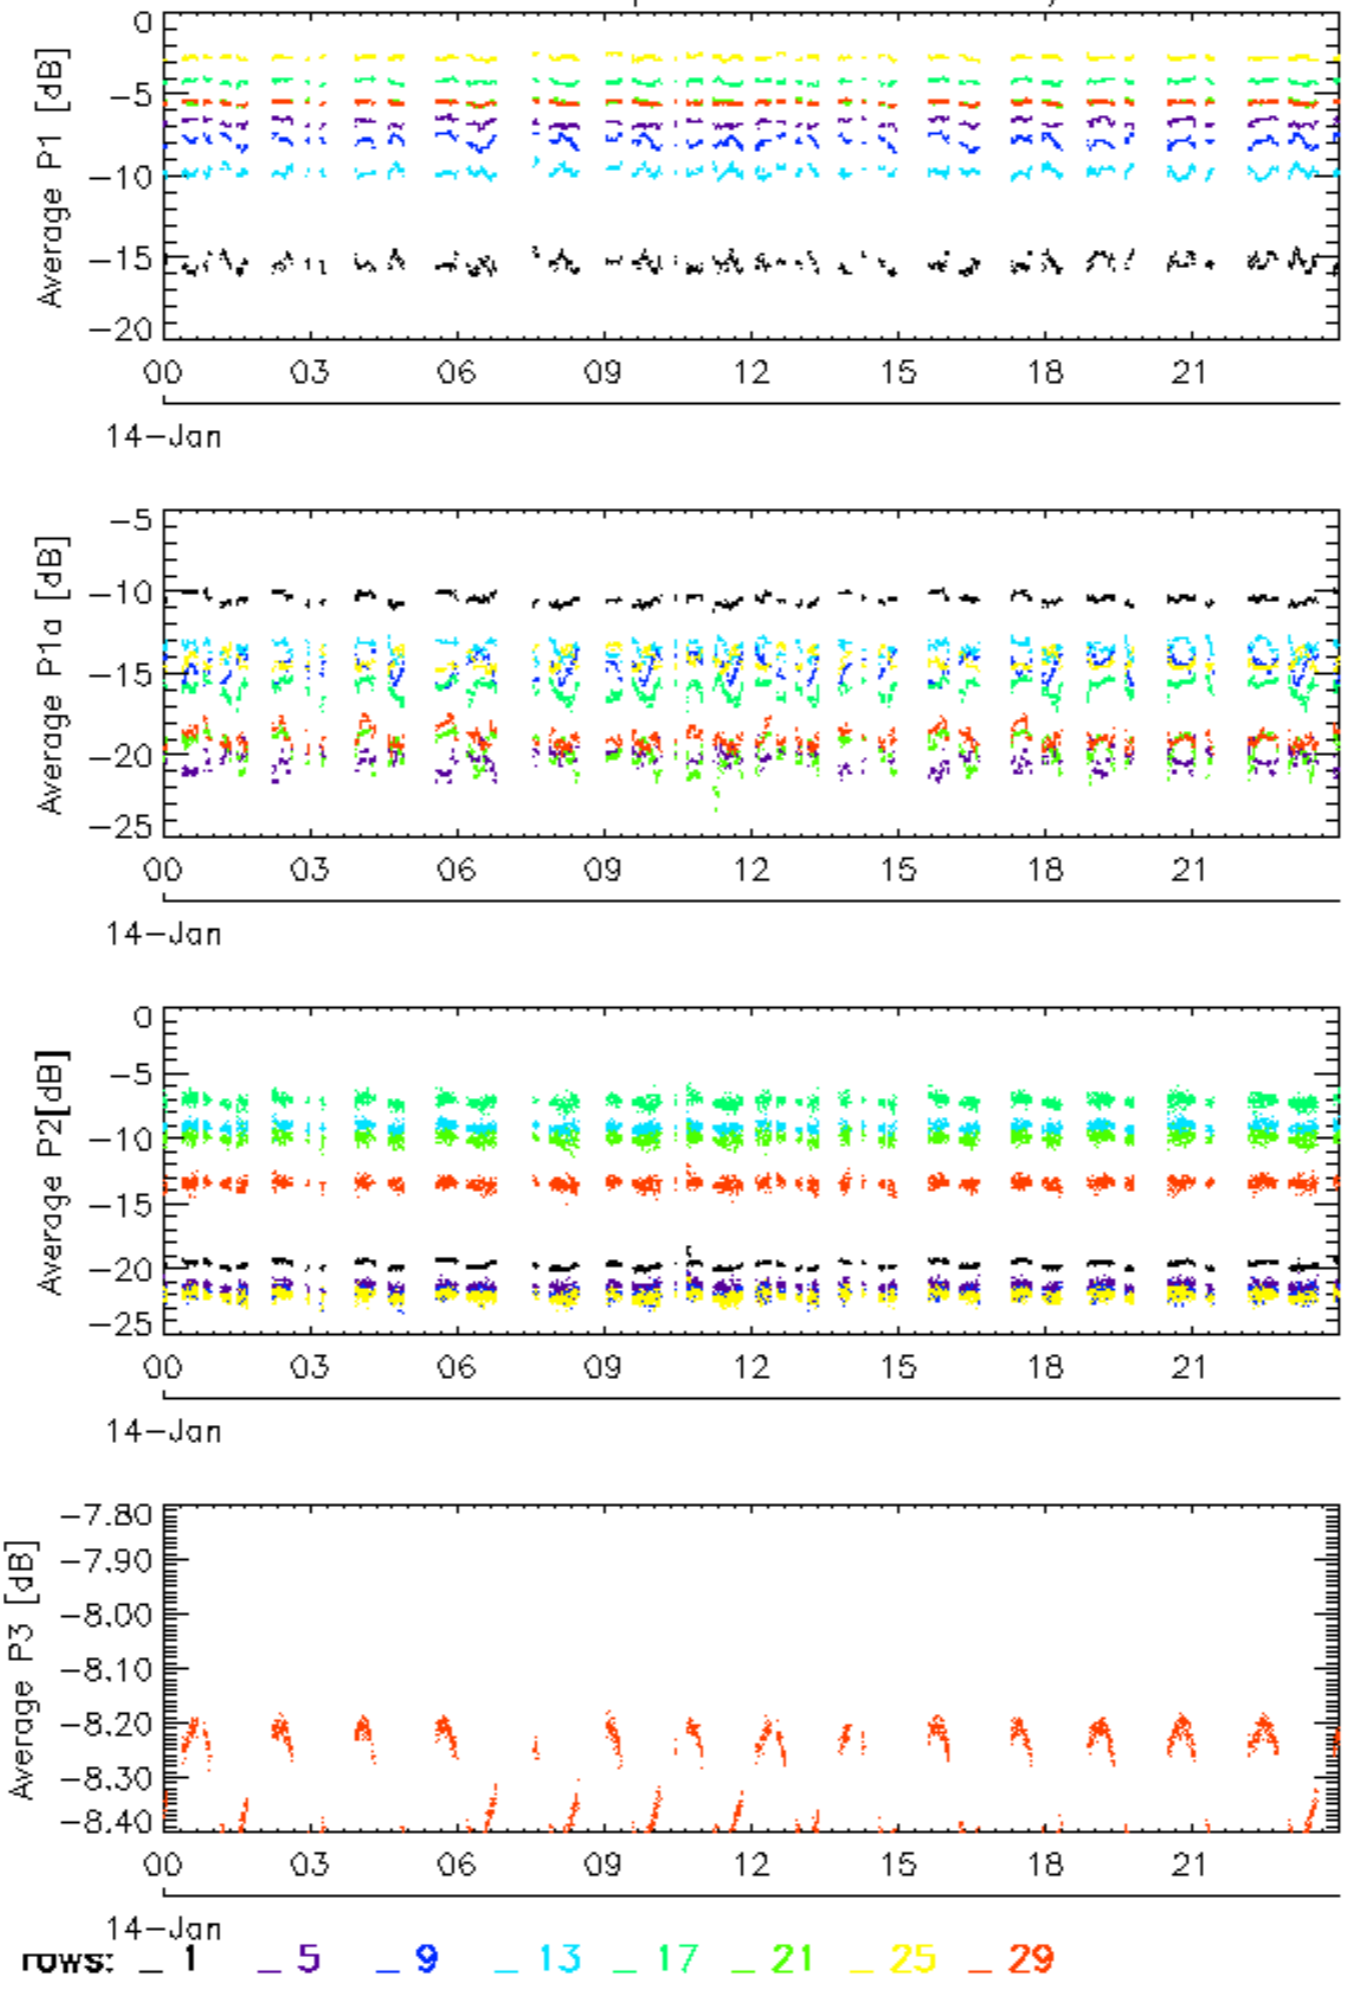


Calibration pulses for WVS IS2 V/V

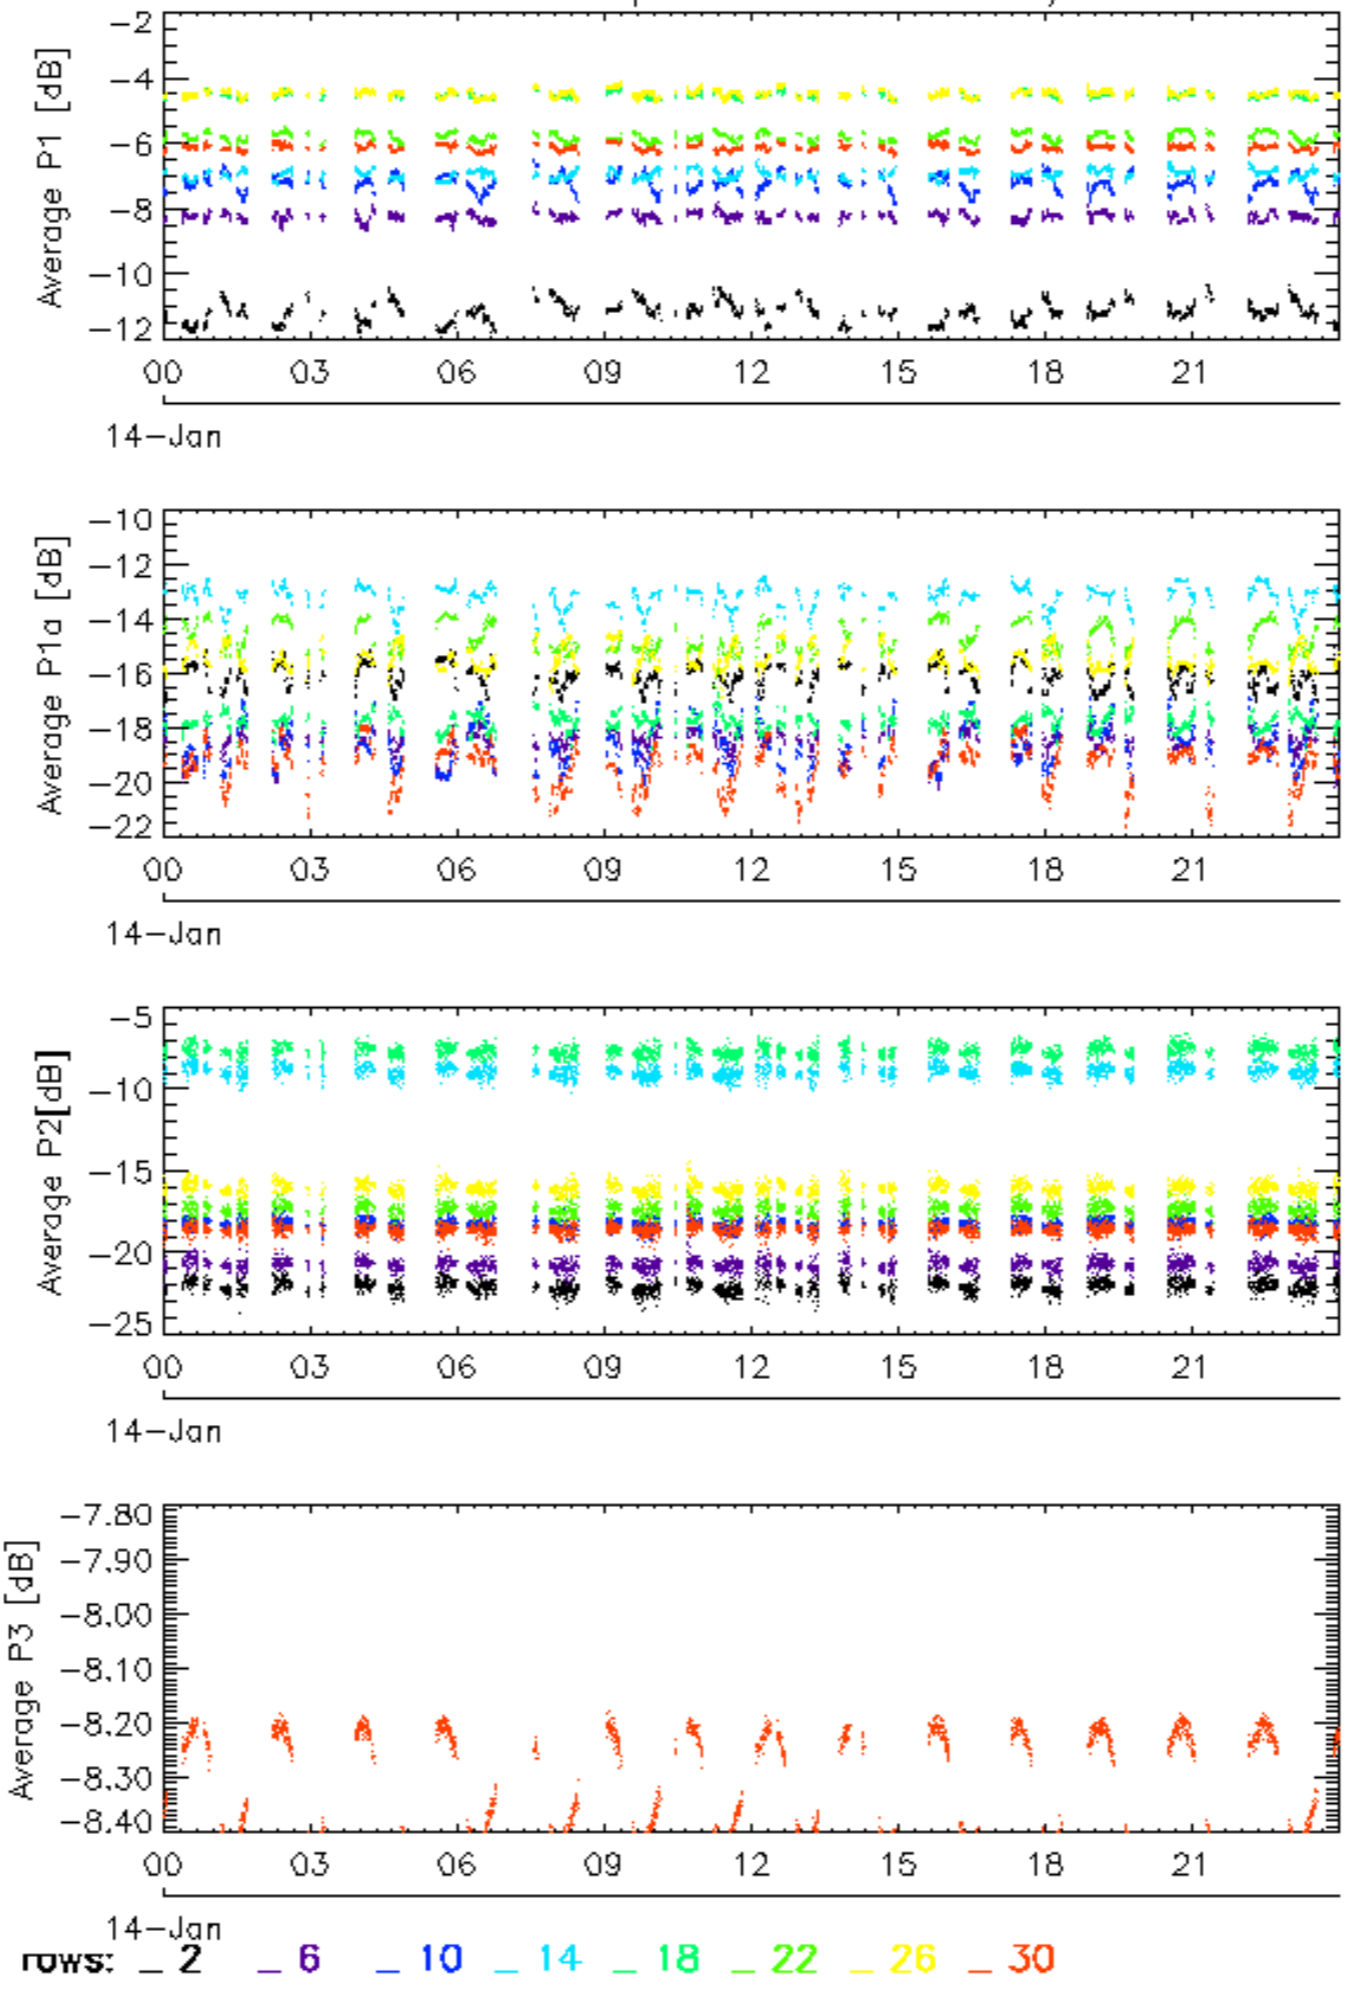



Calibration pulses for WVS IS2 V/V


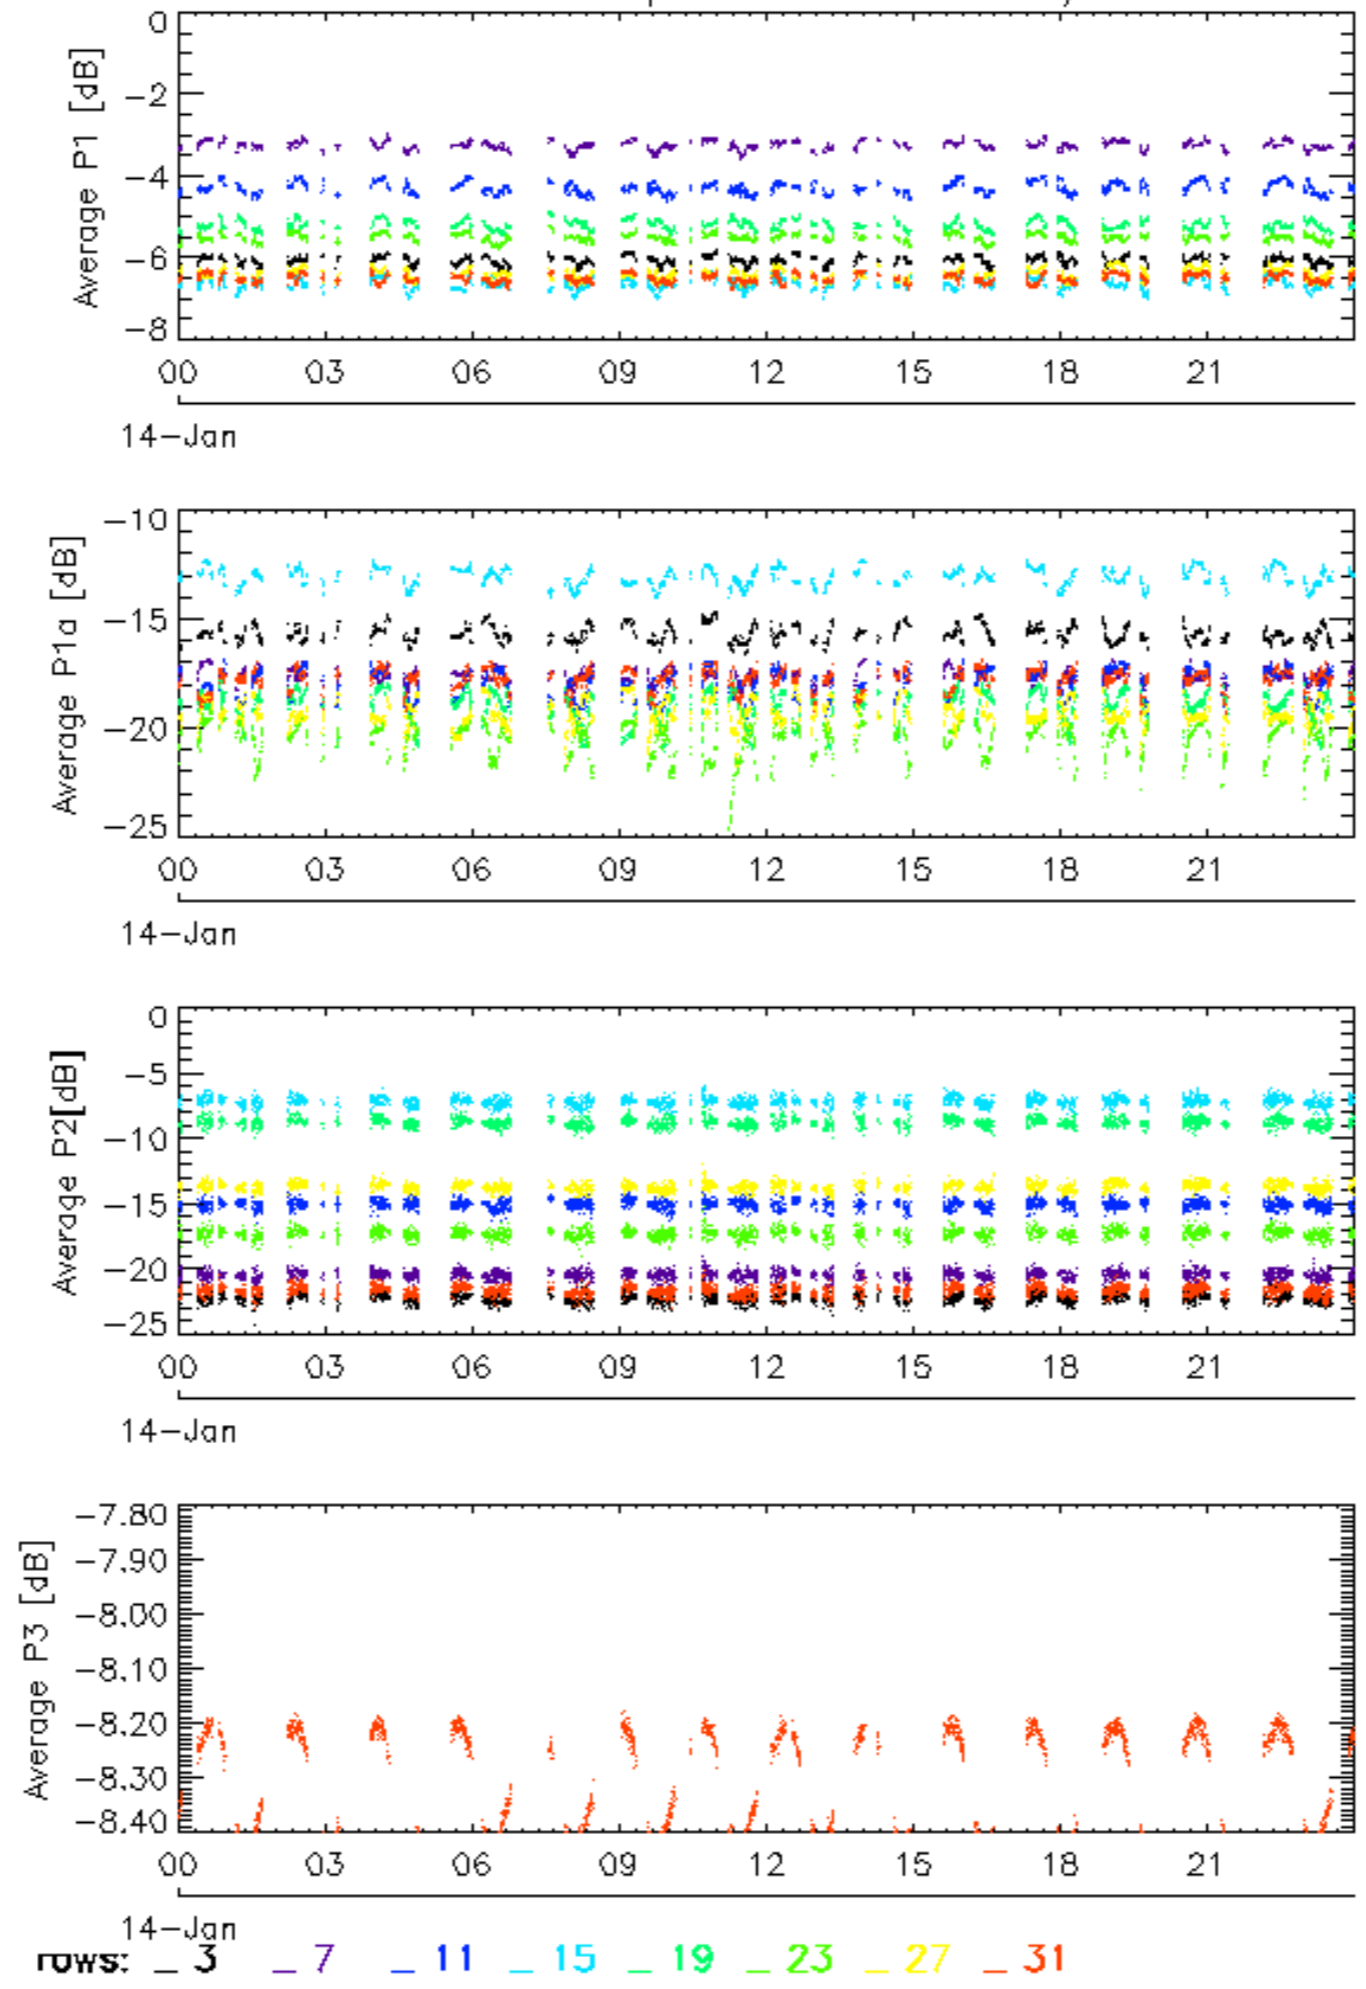




Calibration pulses for WVS IS2 V/V


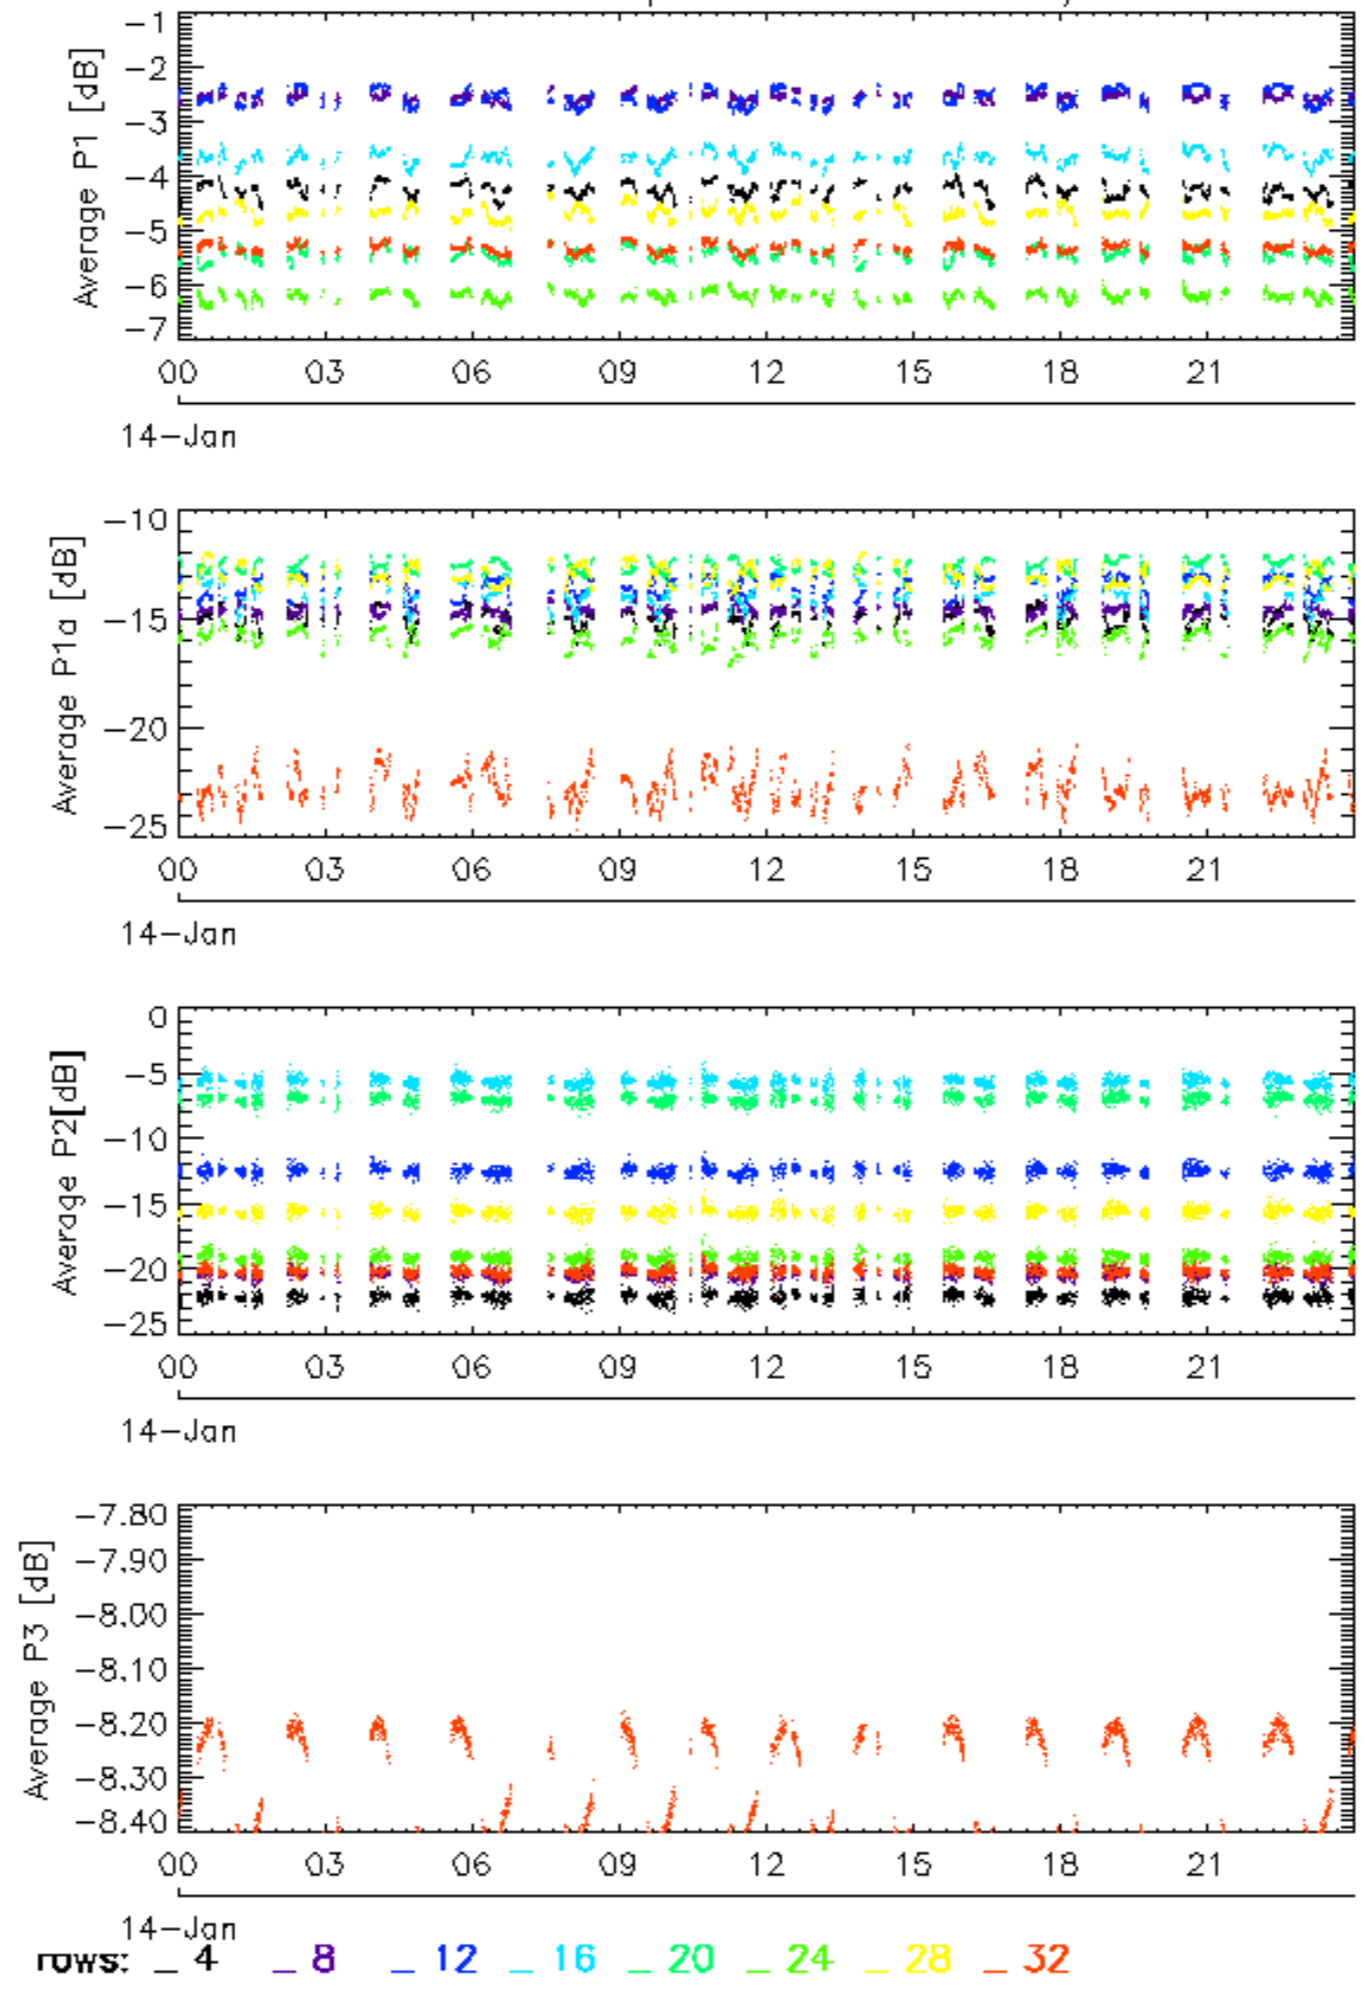



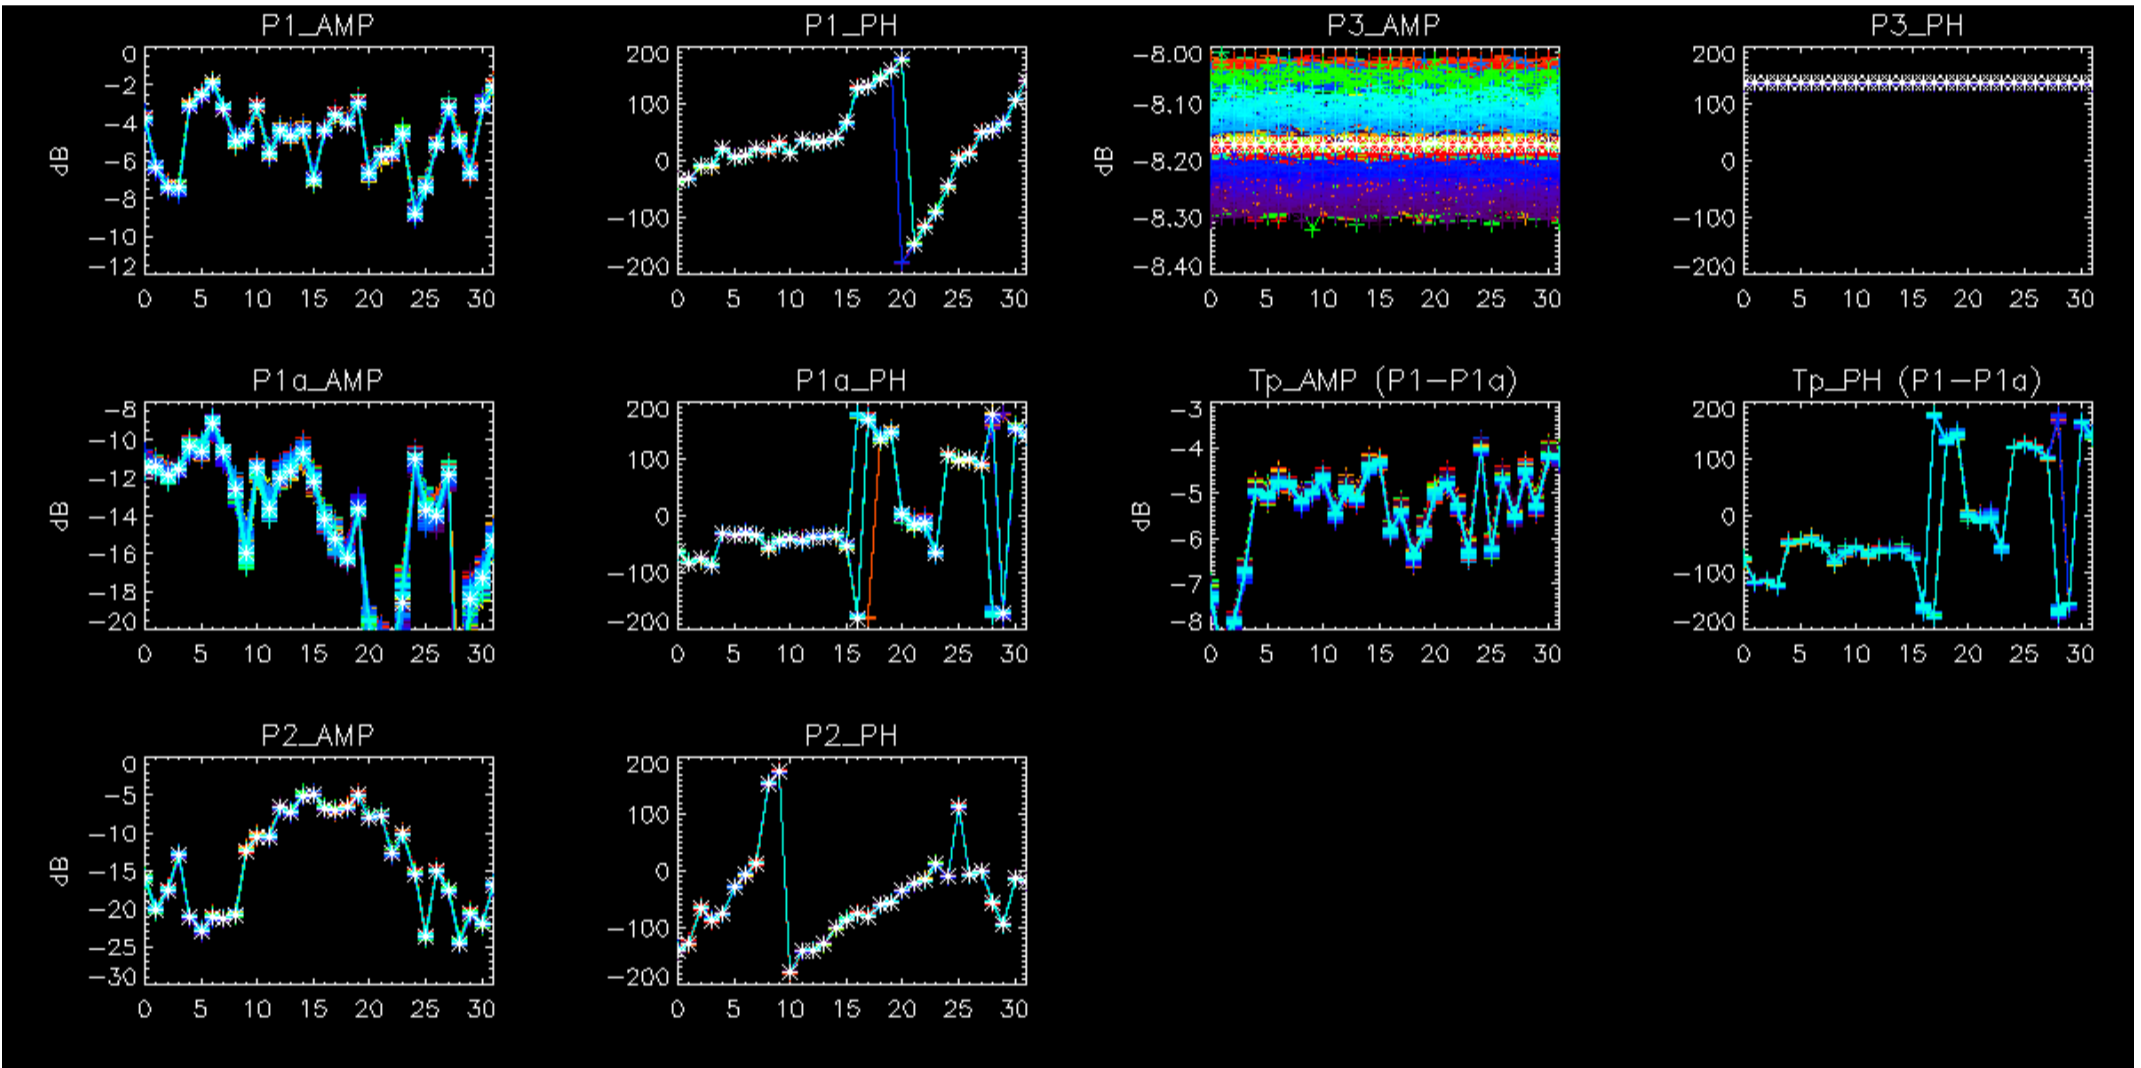


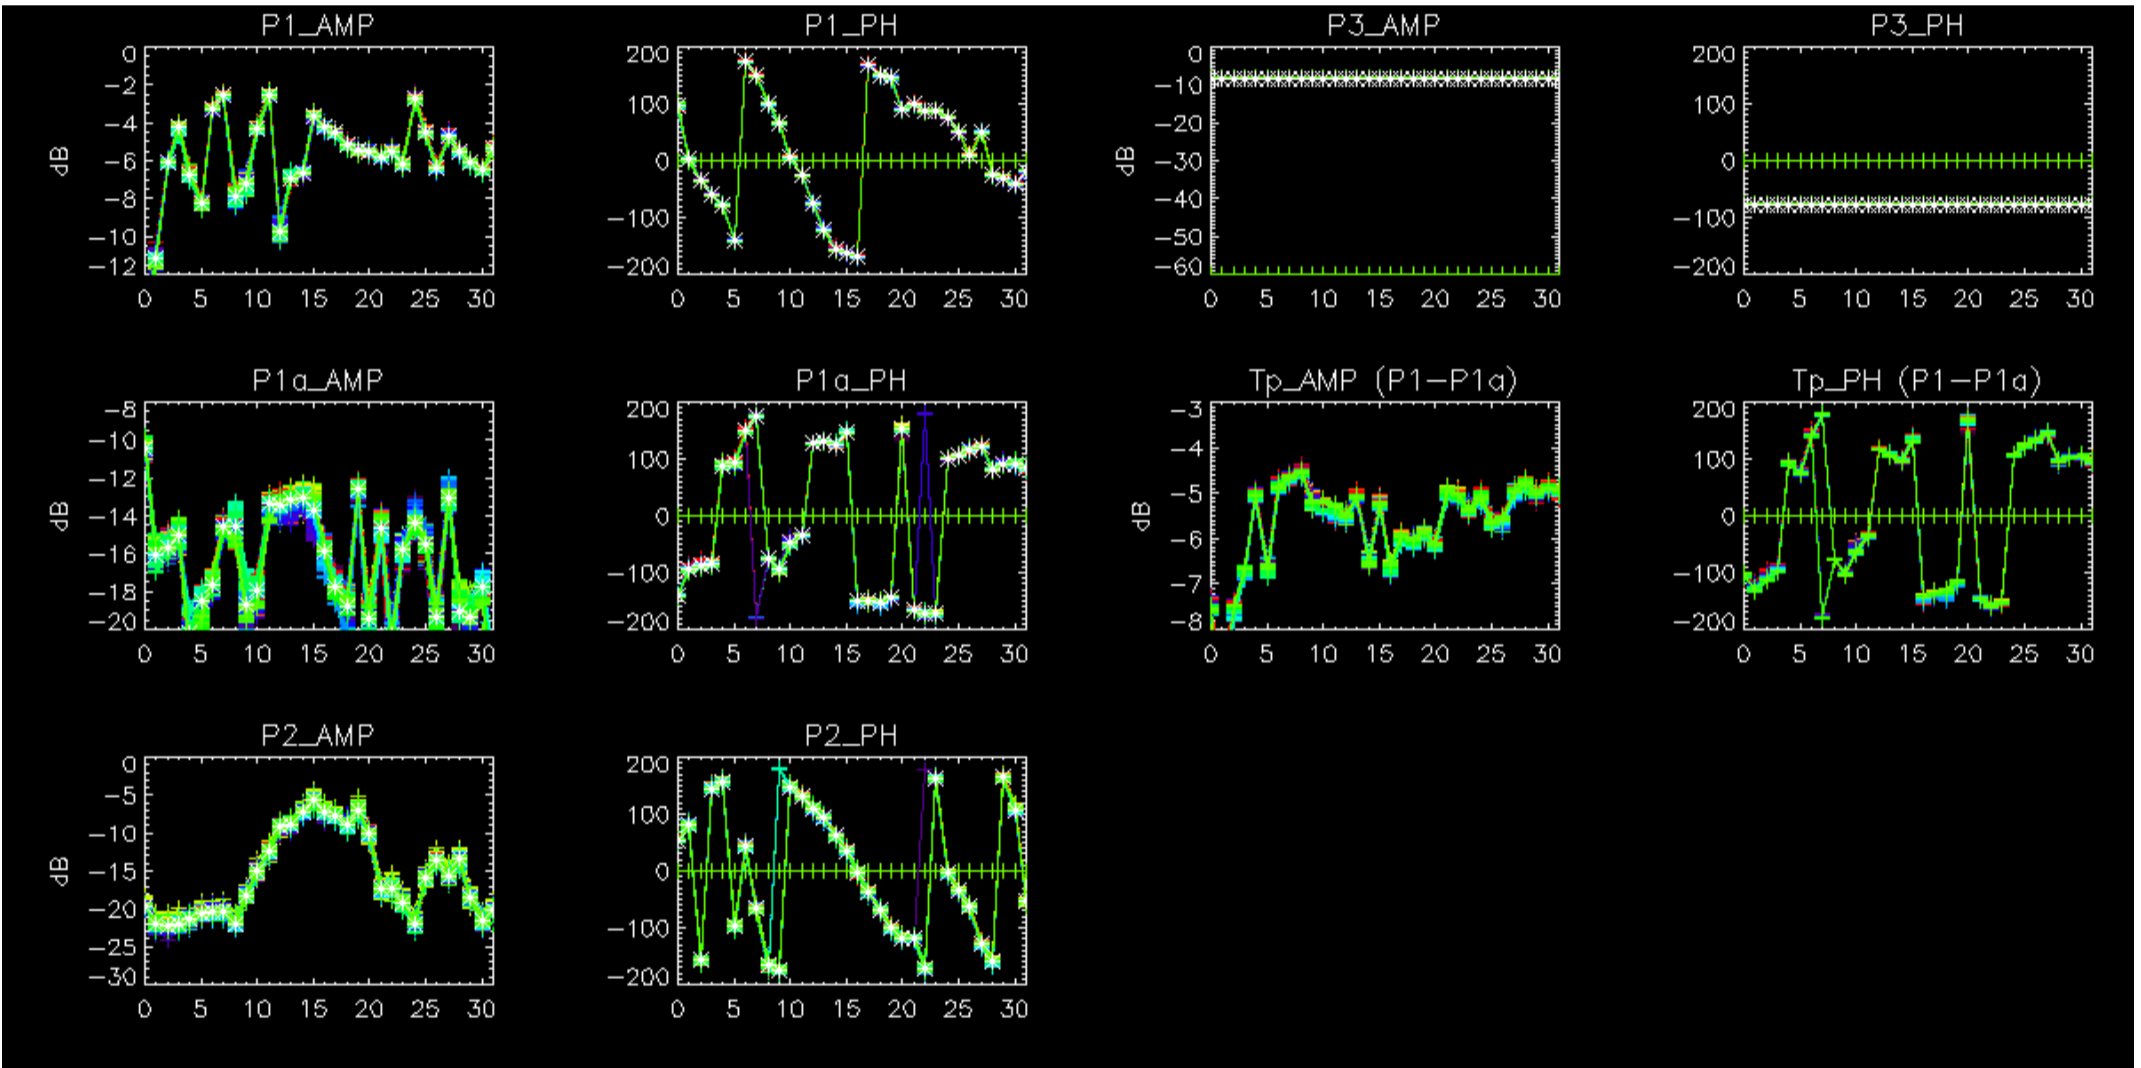

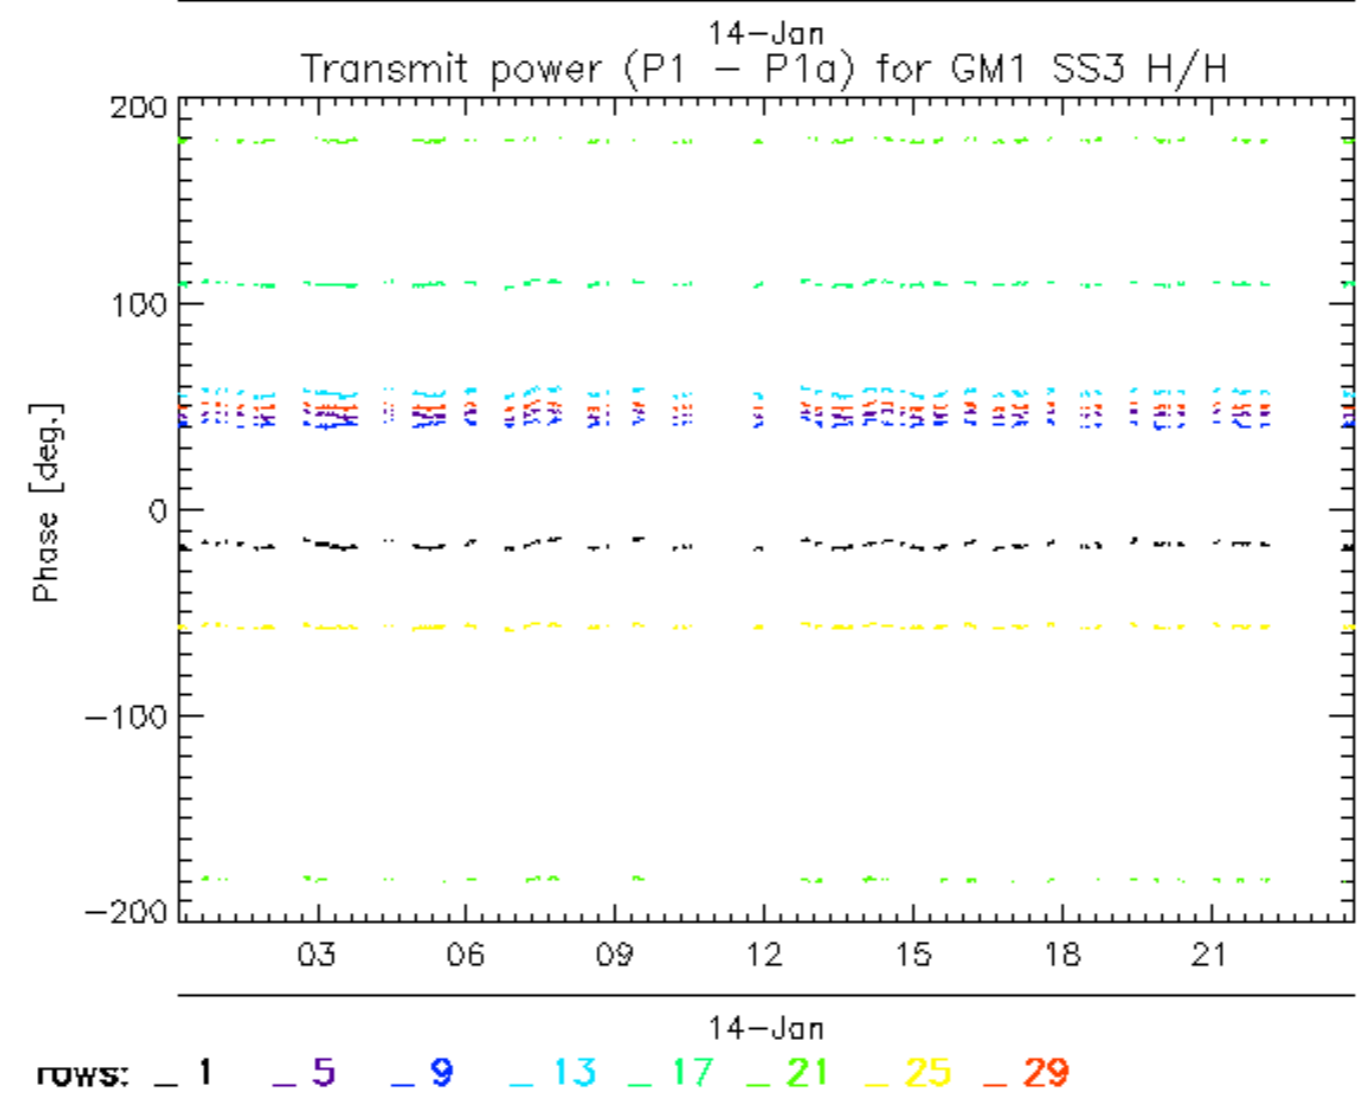
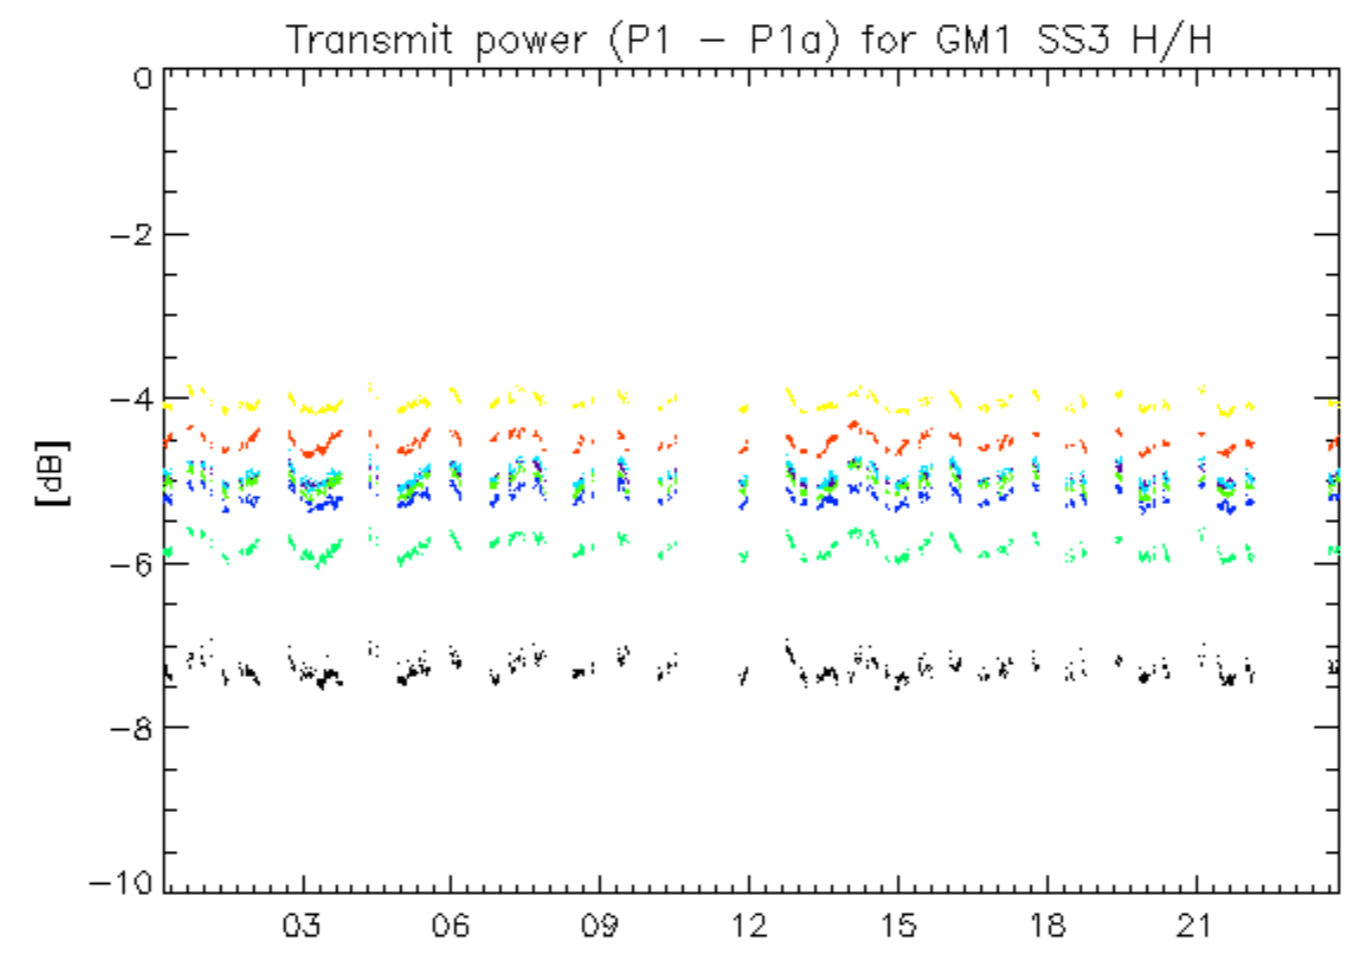


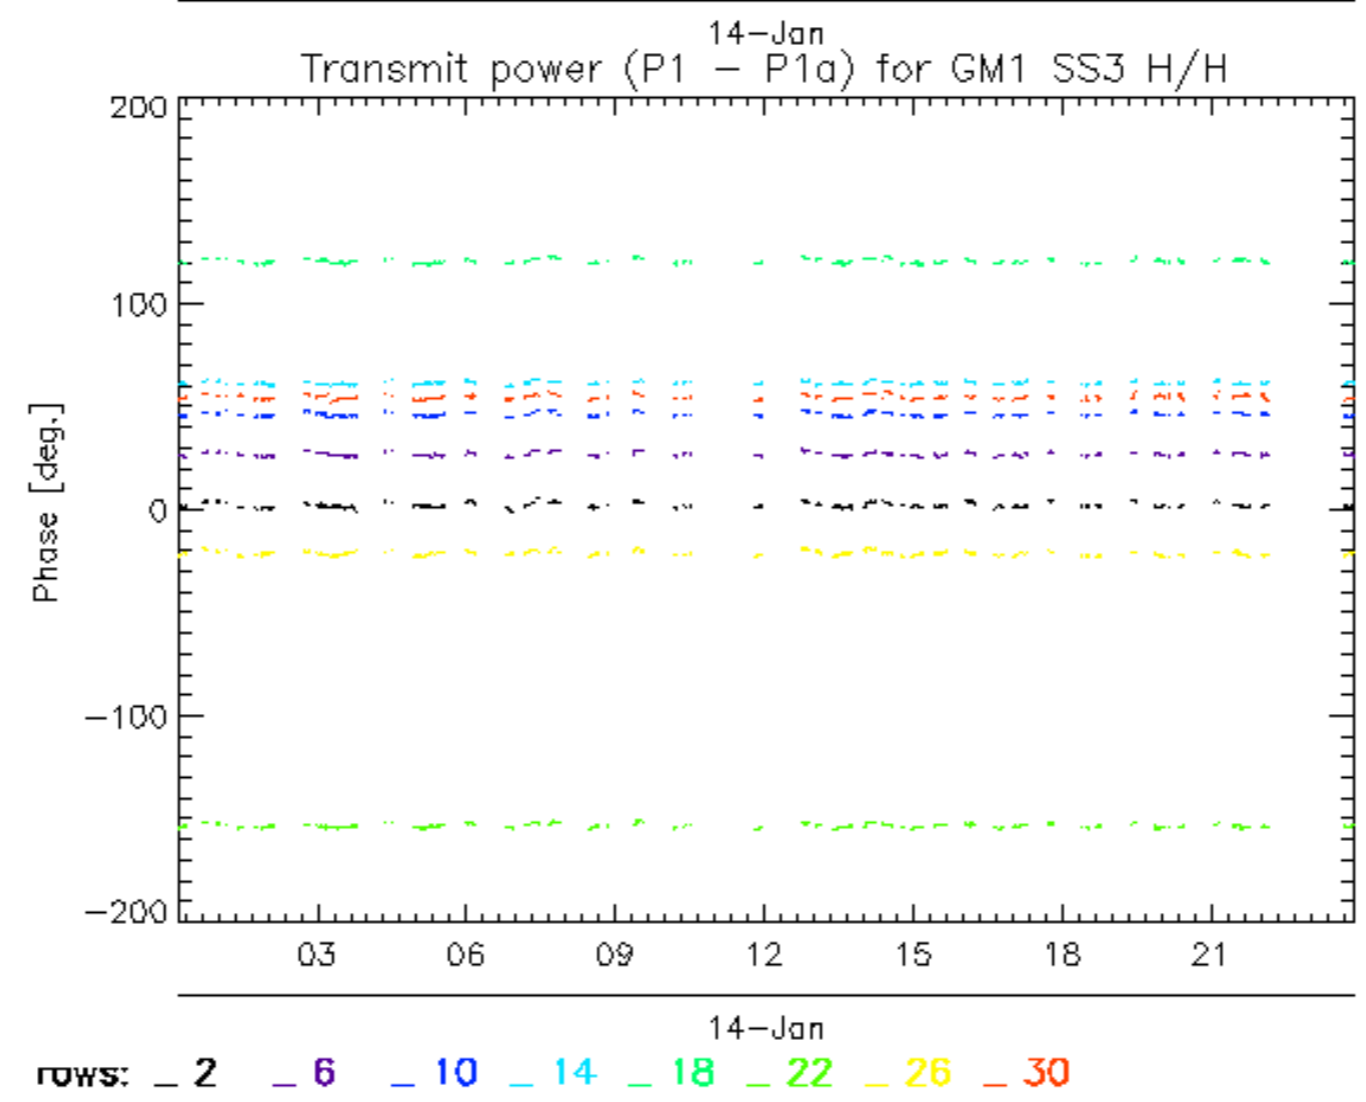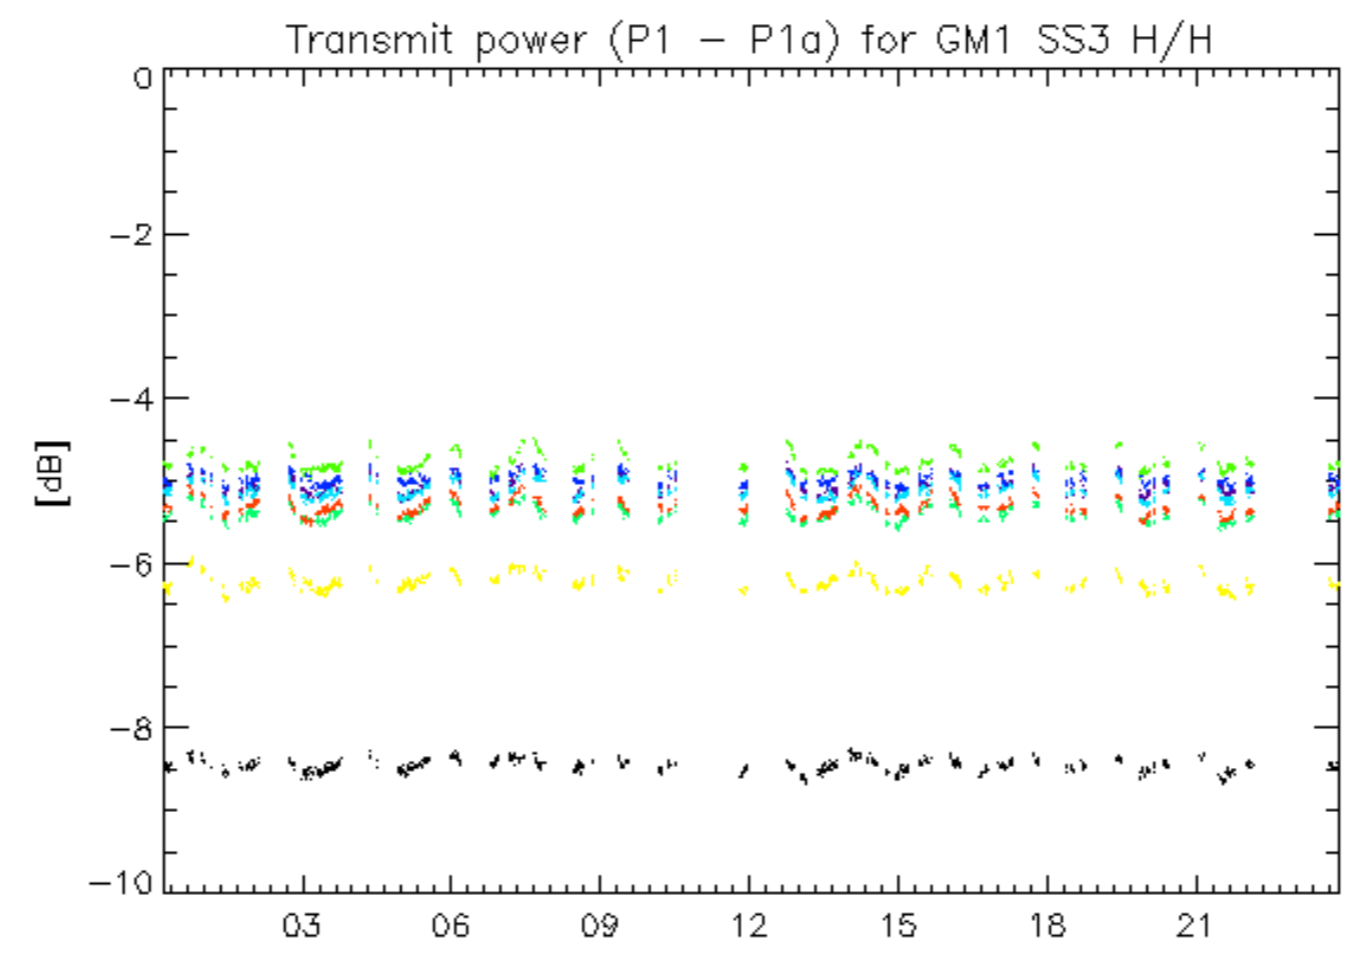

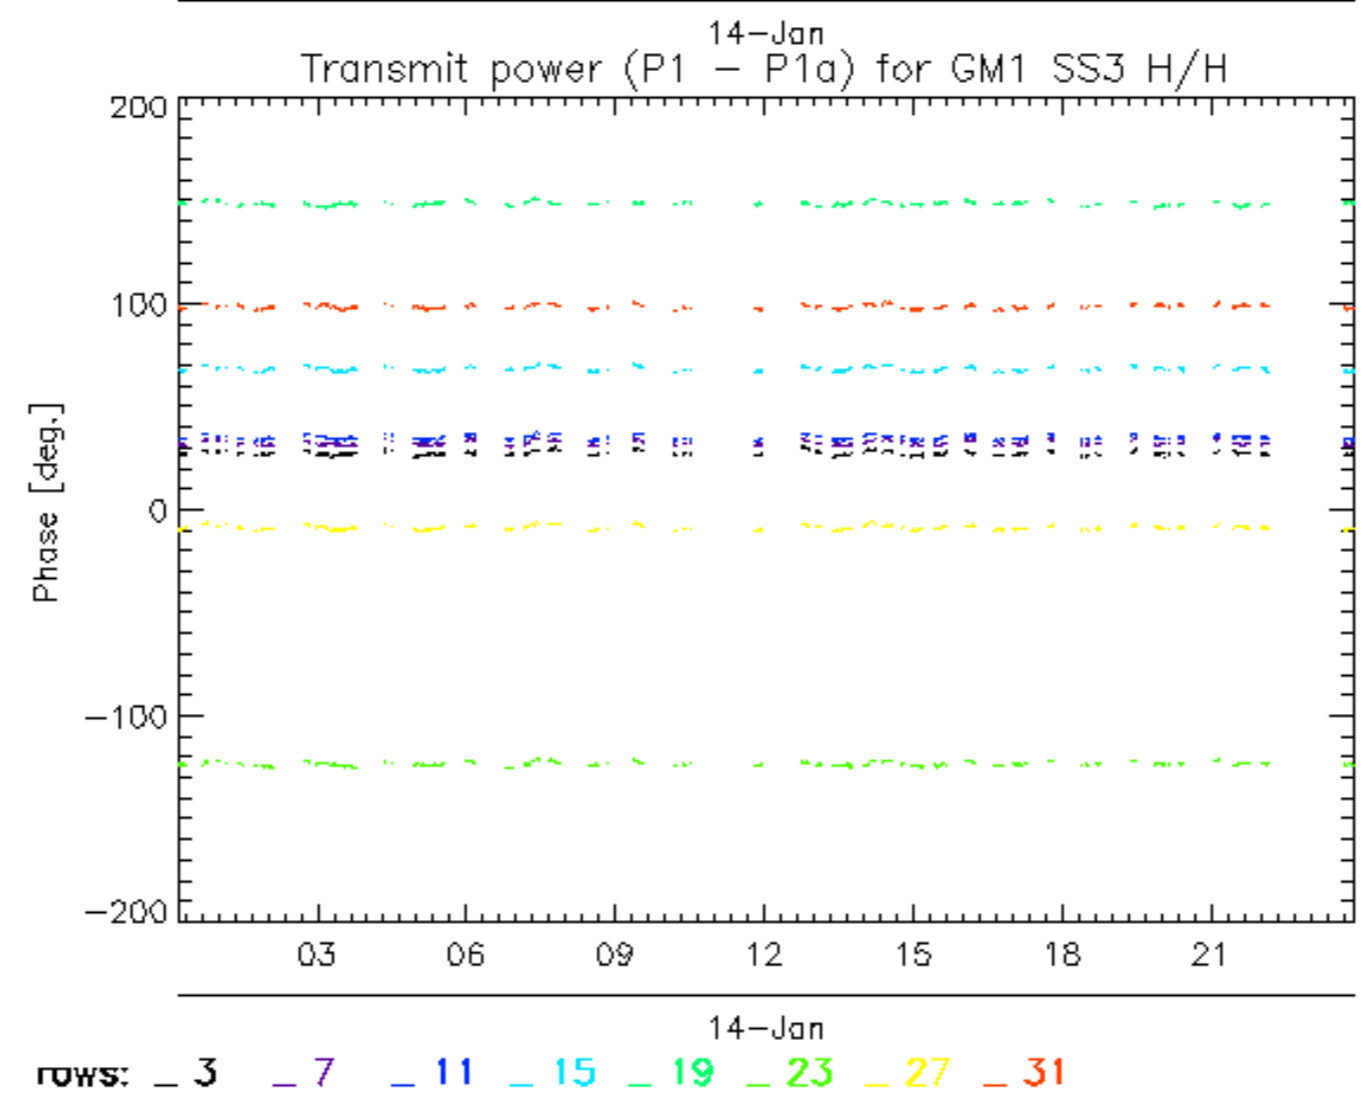
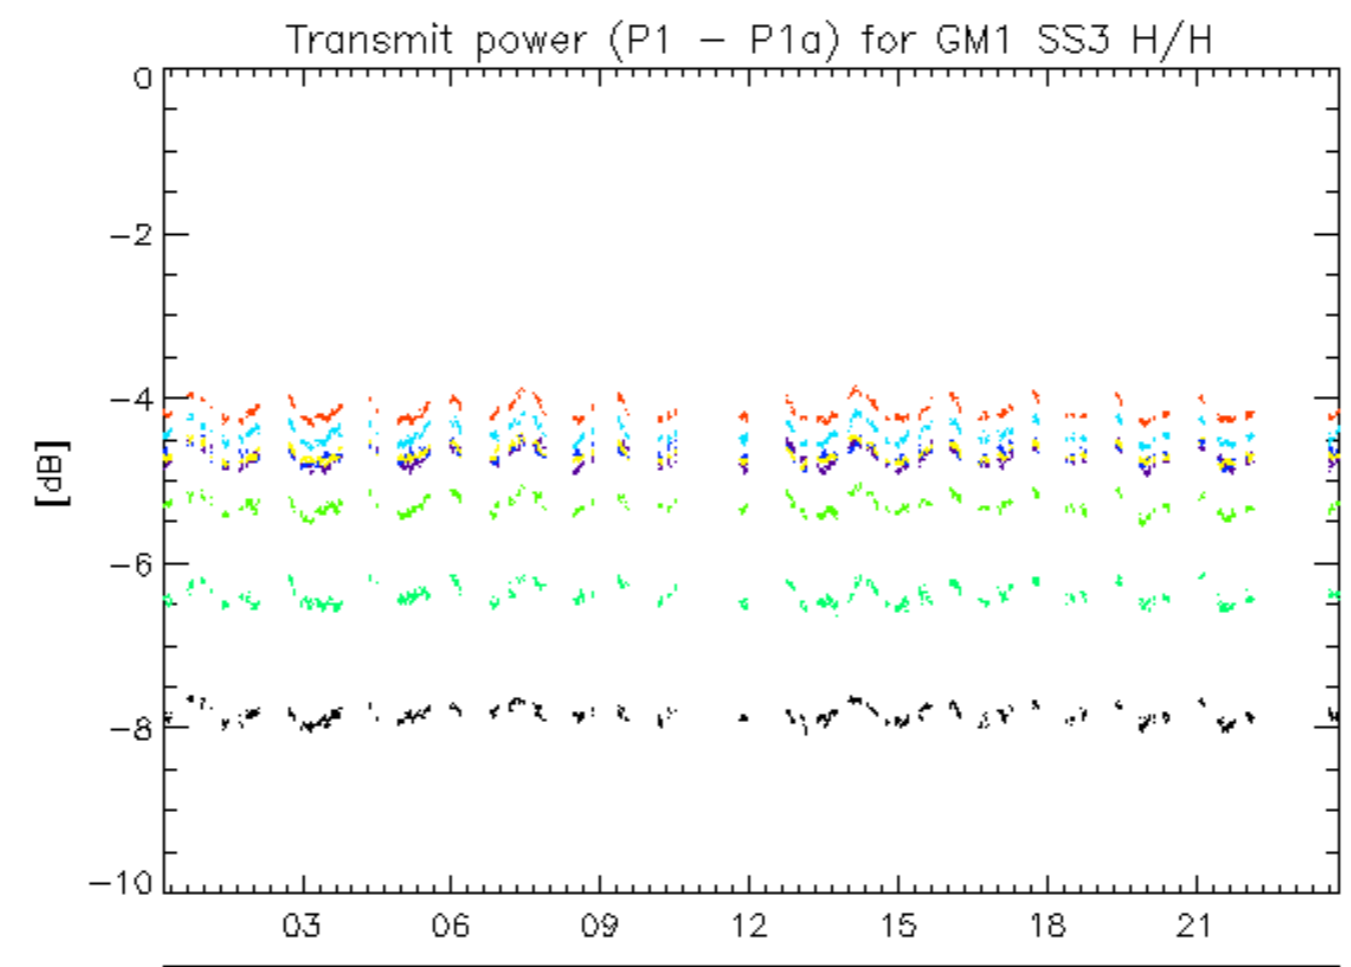


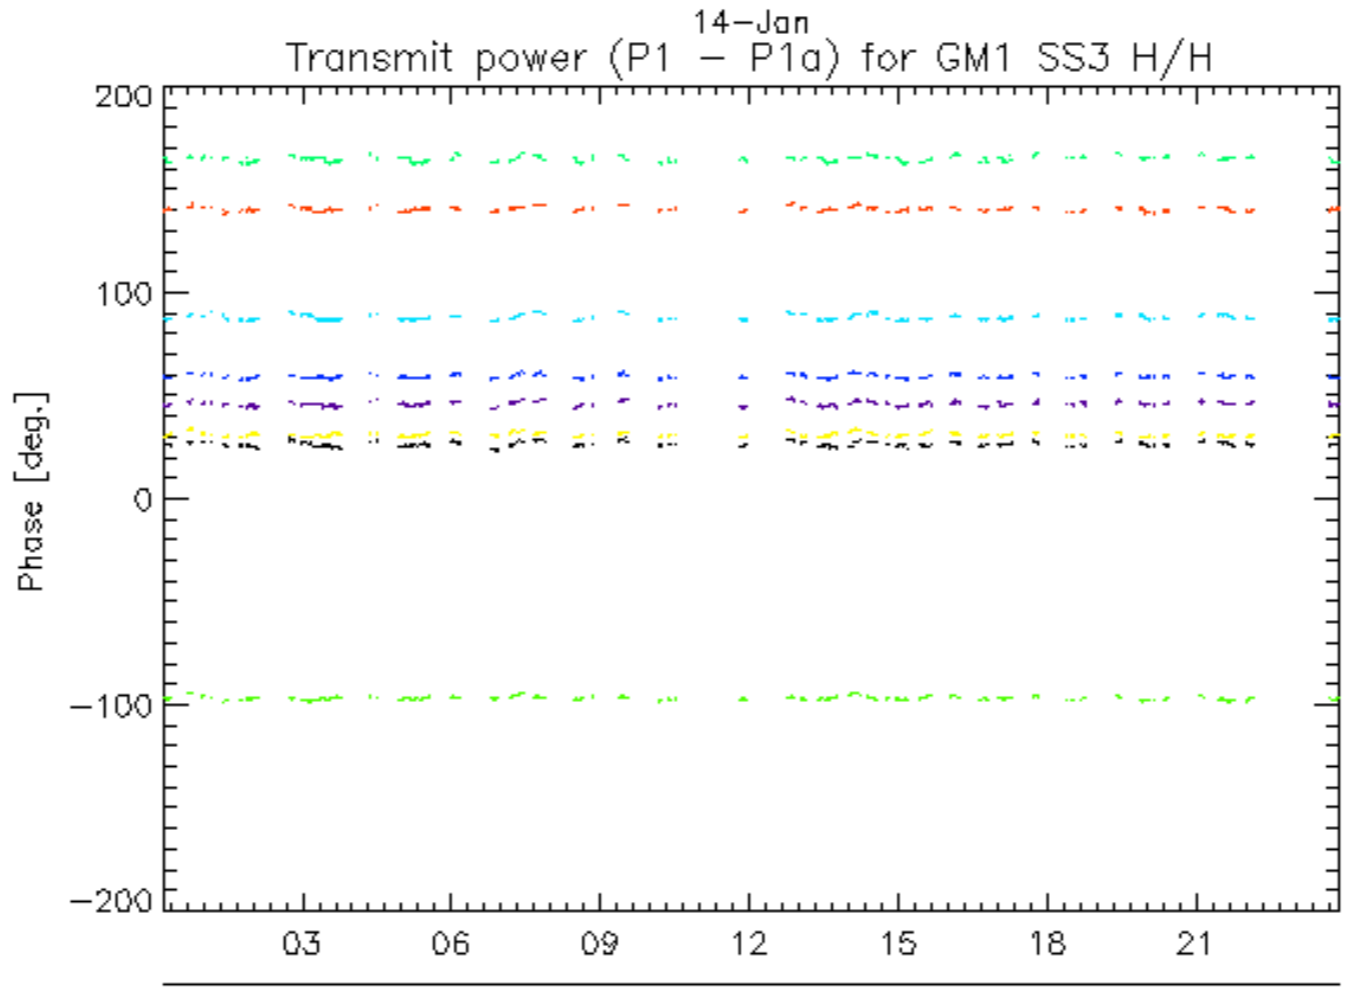
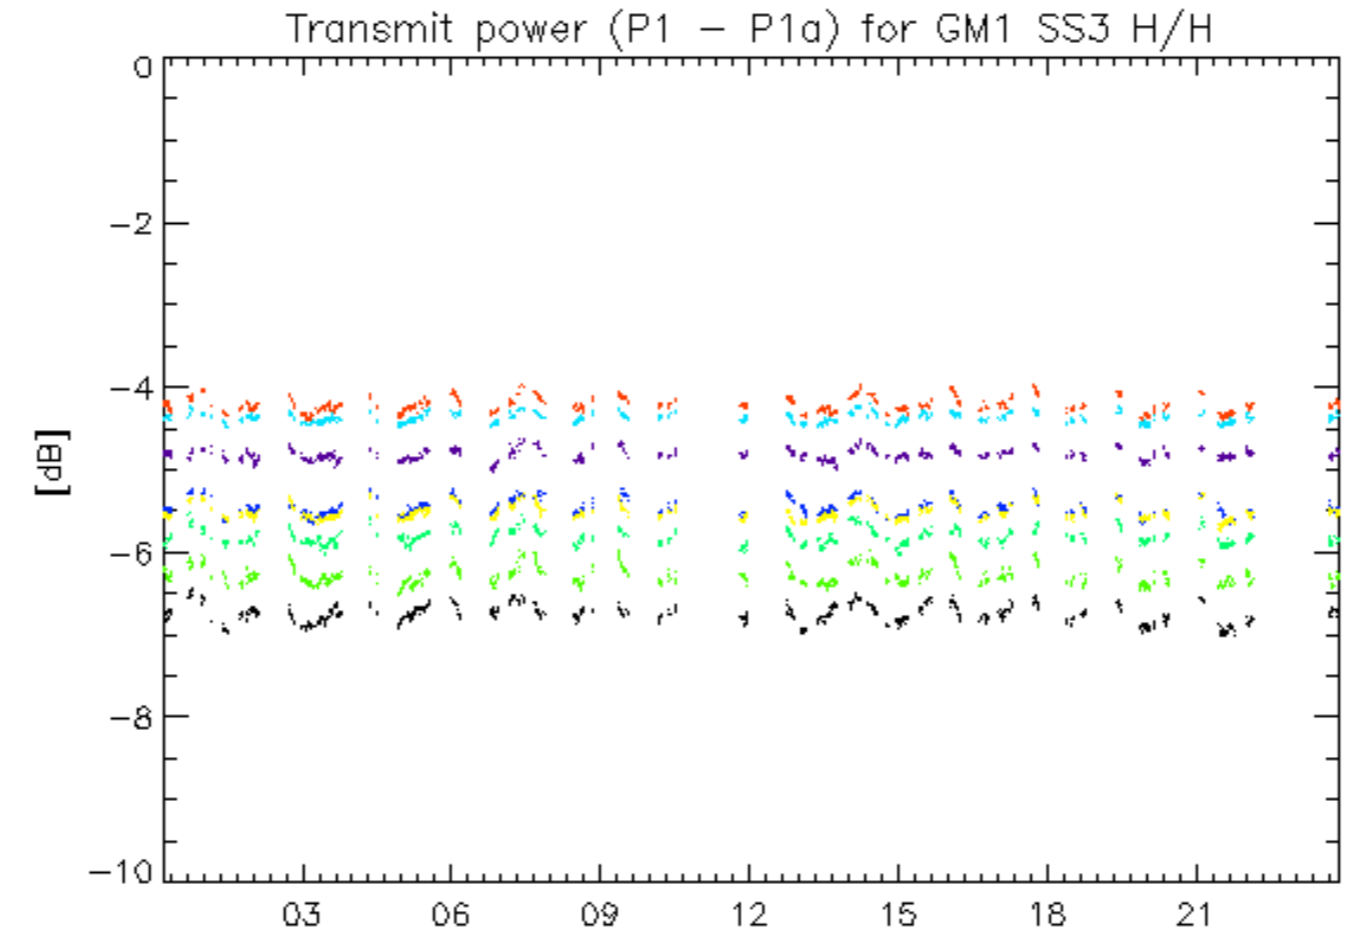


14-Jan
rows: _ 4 _ 8 _ 12 _ 16 _ 20 _ 24 _ 28 _ 32

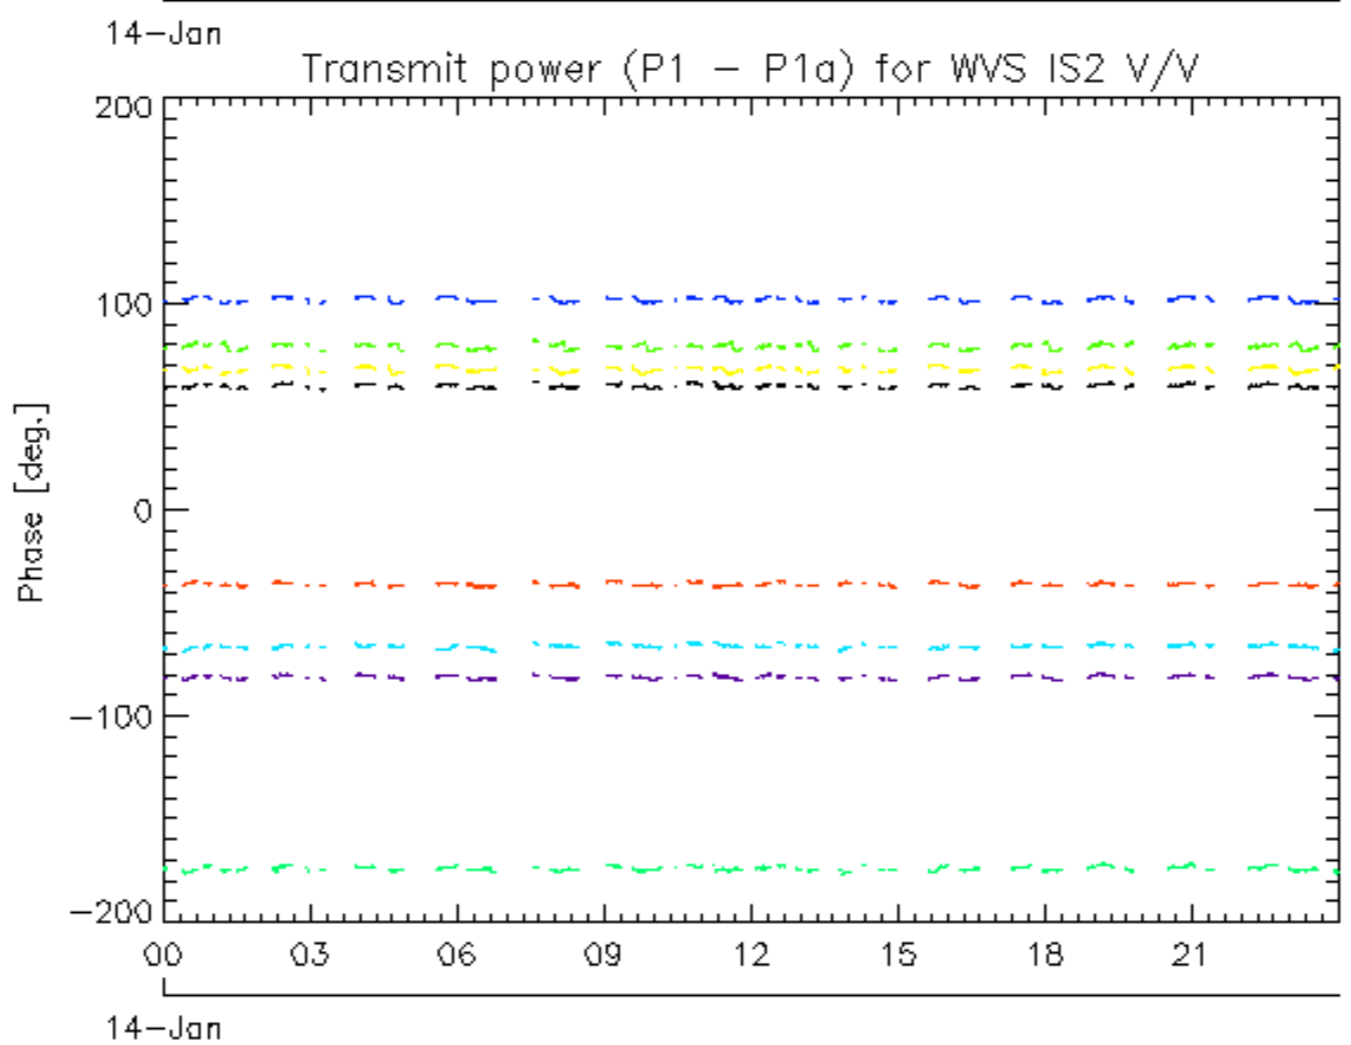
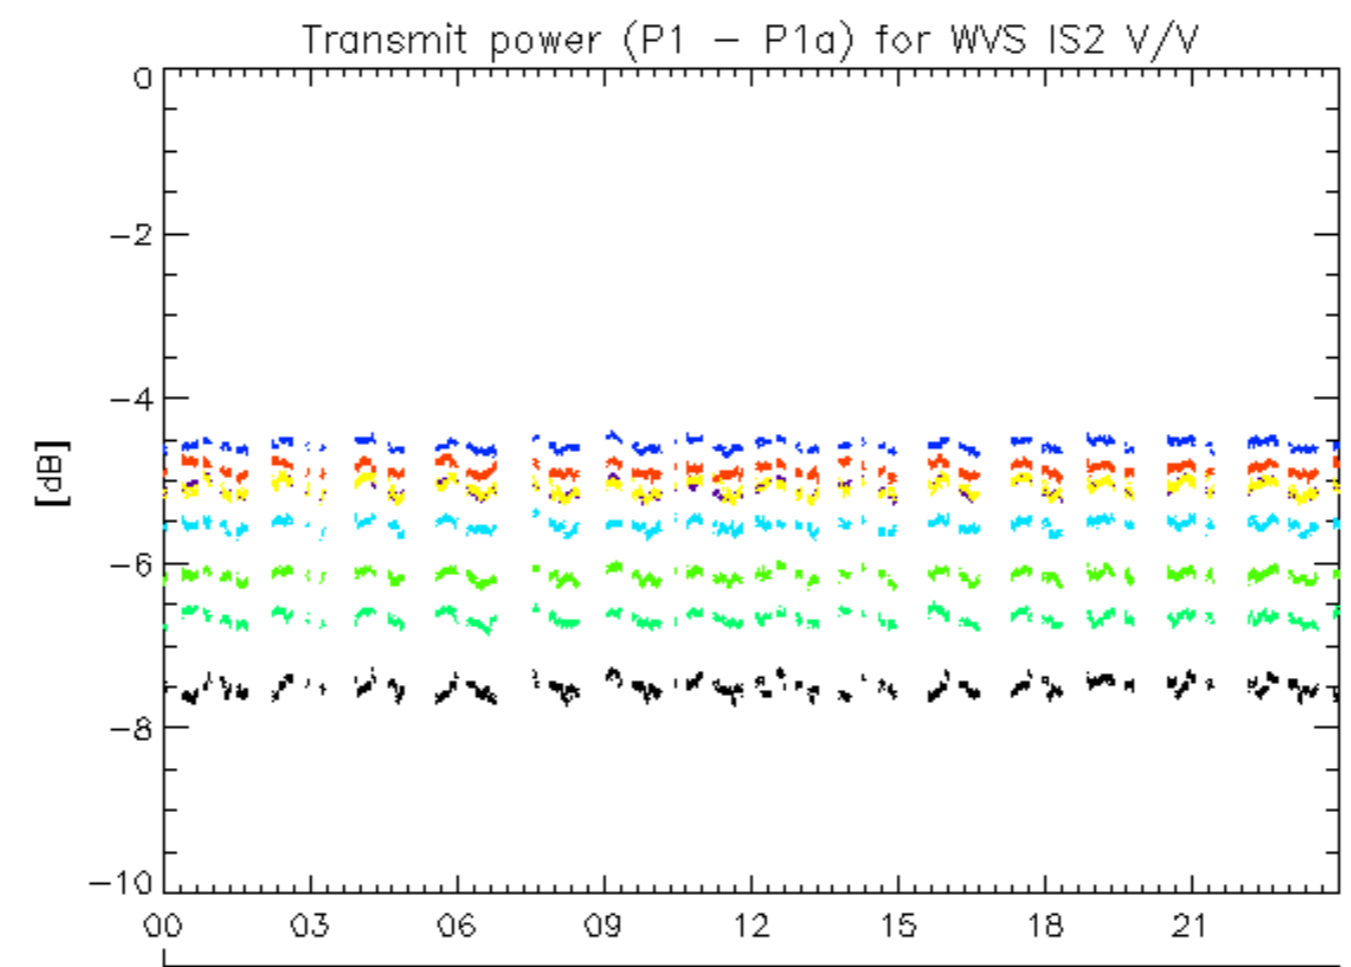


rows: - 1 - 5 - 9 - 13 - 17 - 21 - 25 - 29

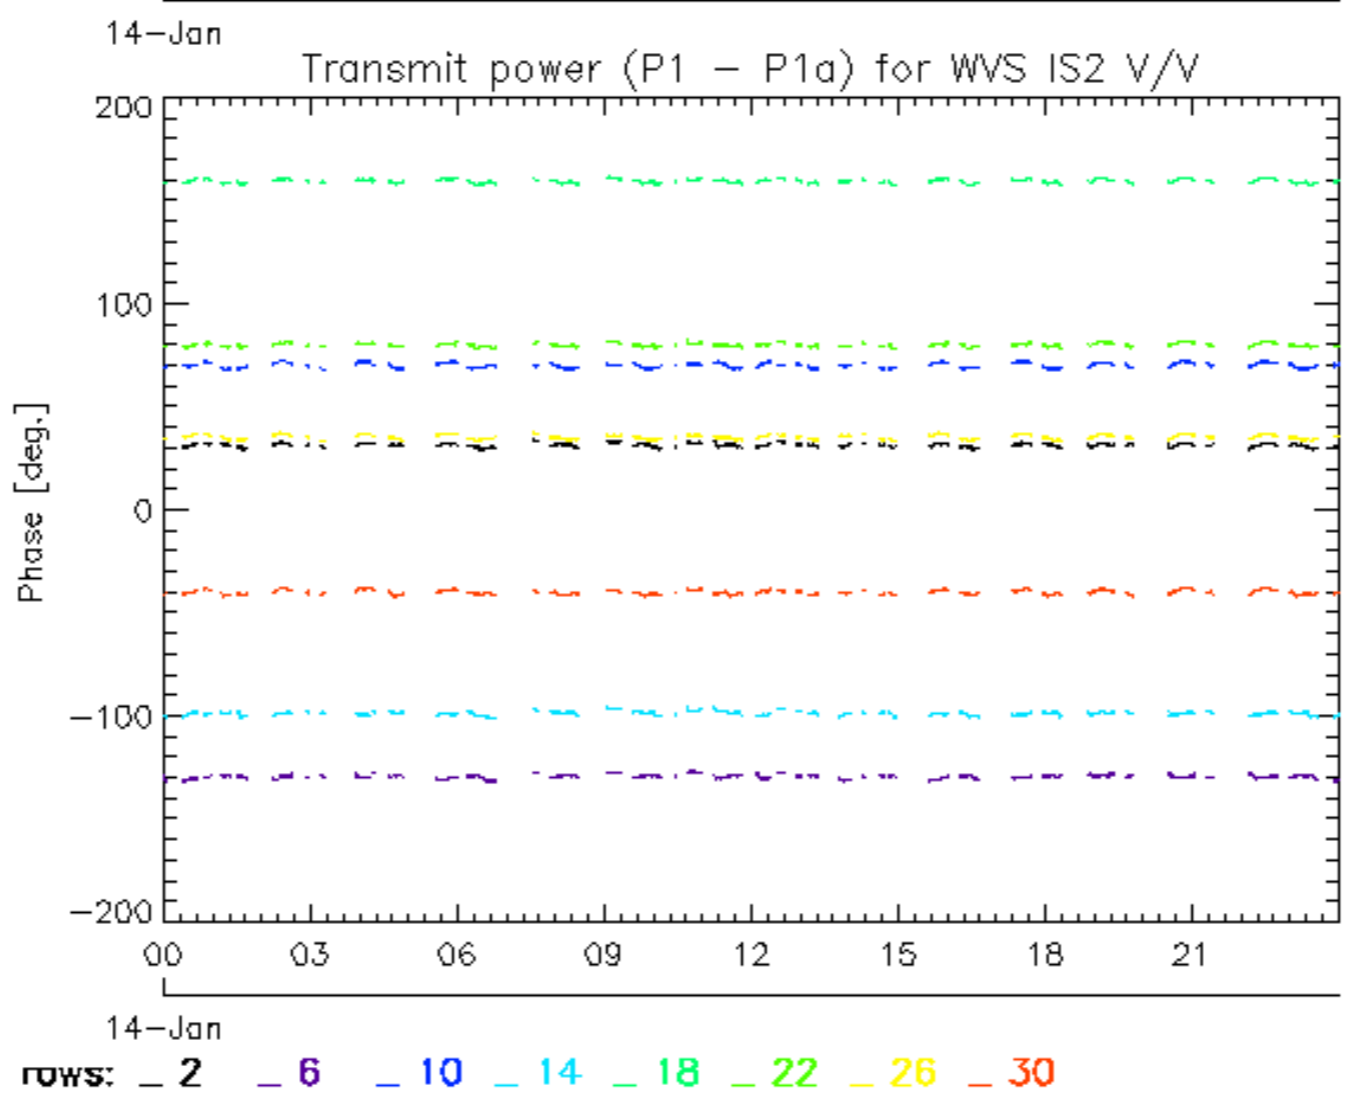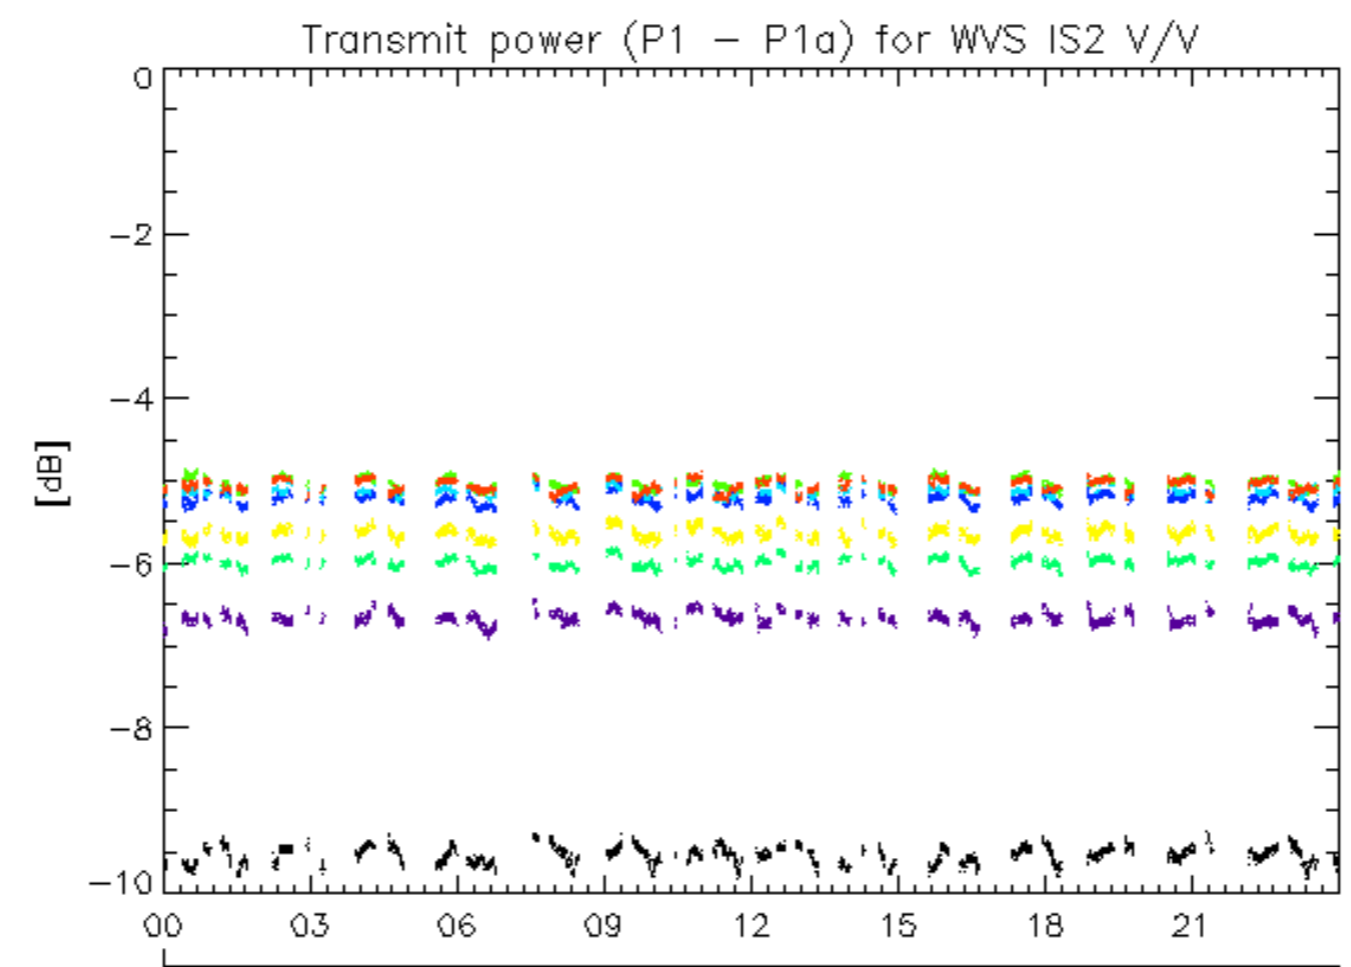

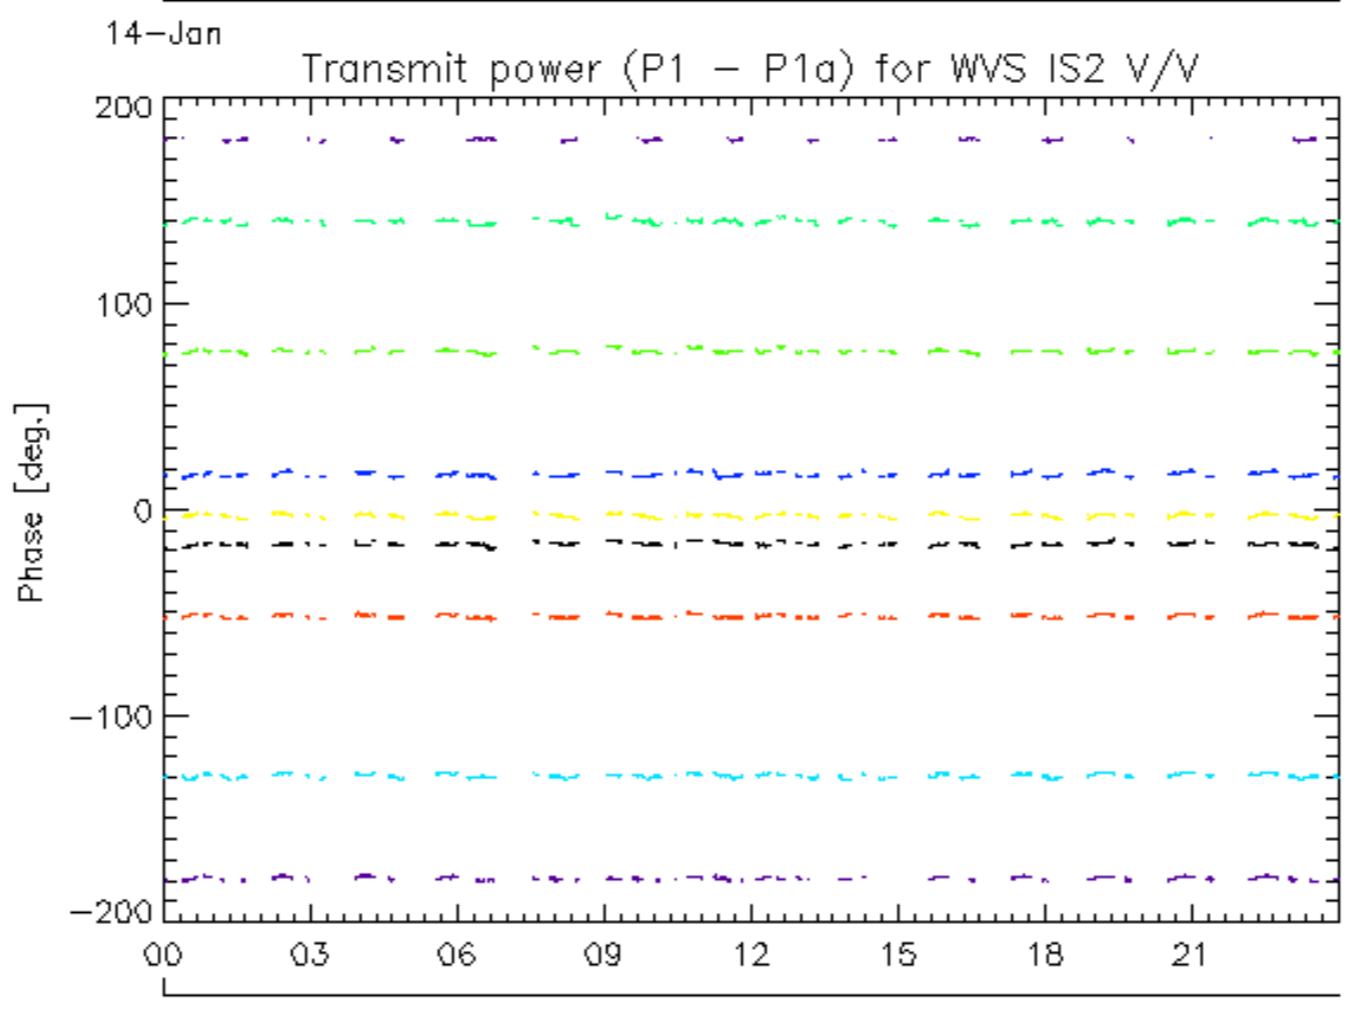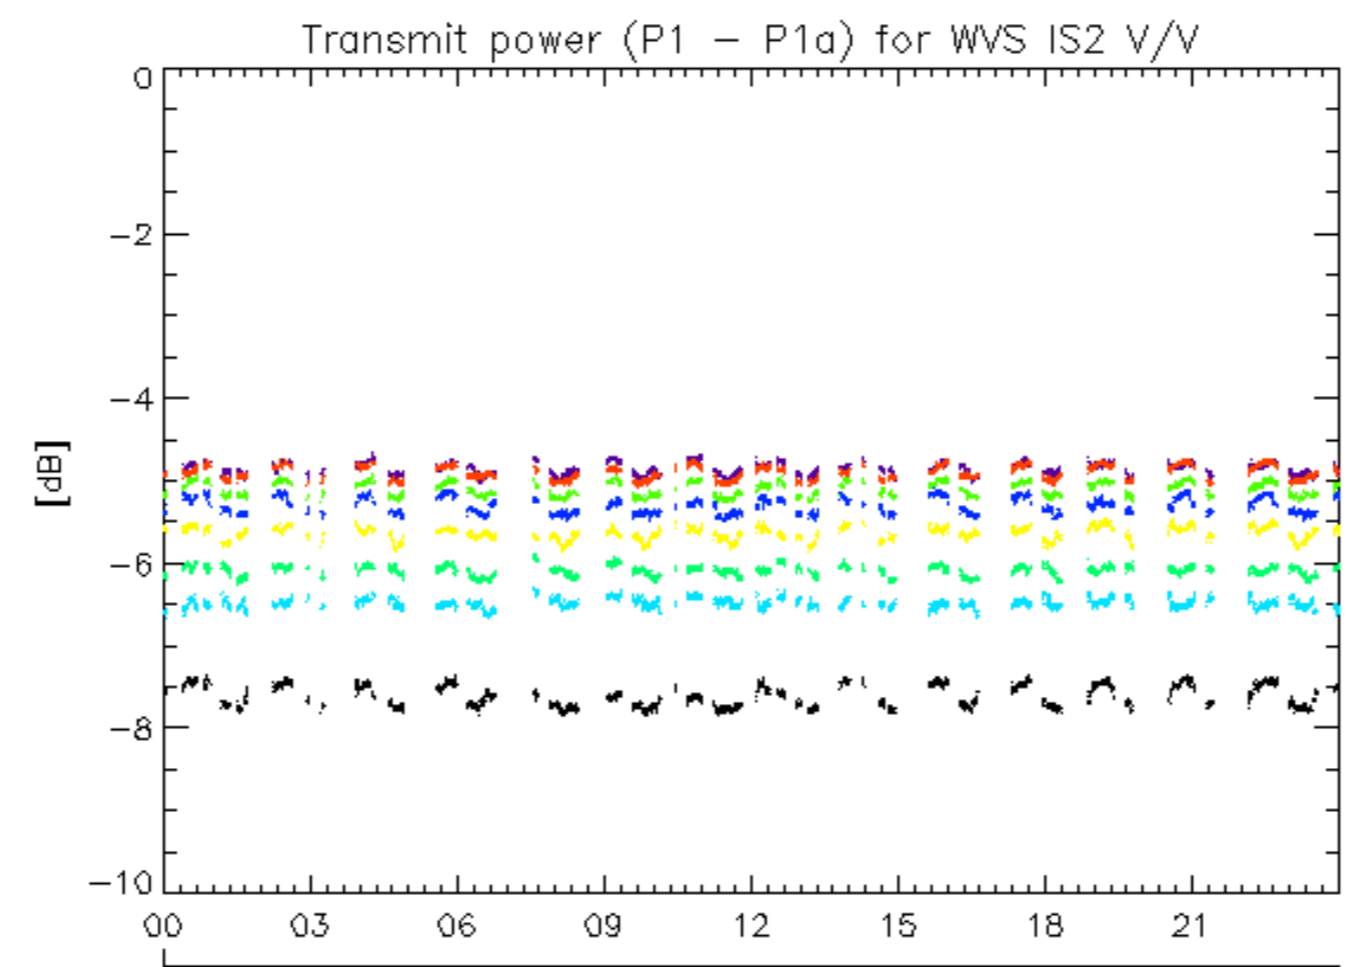

rows: - 3 - 7 - 11 - 15 - 19 - 23 - 27 - 31

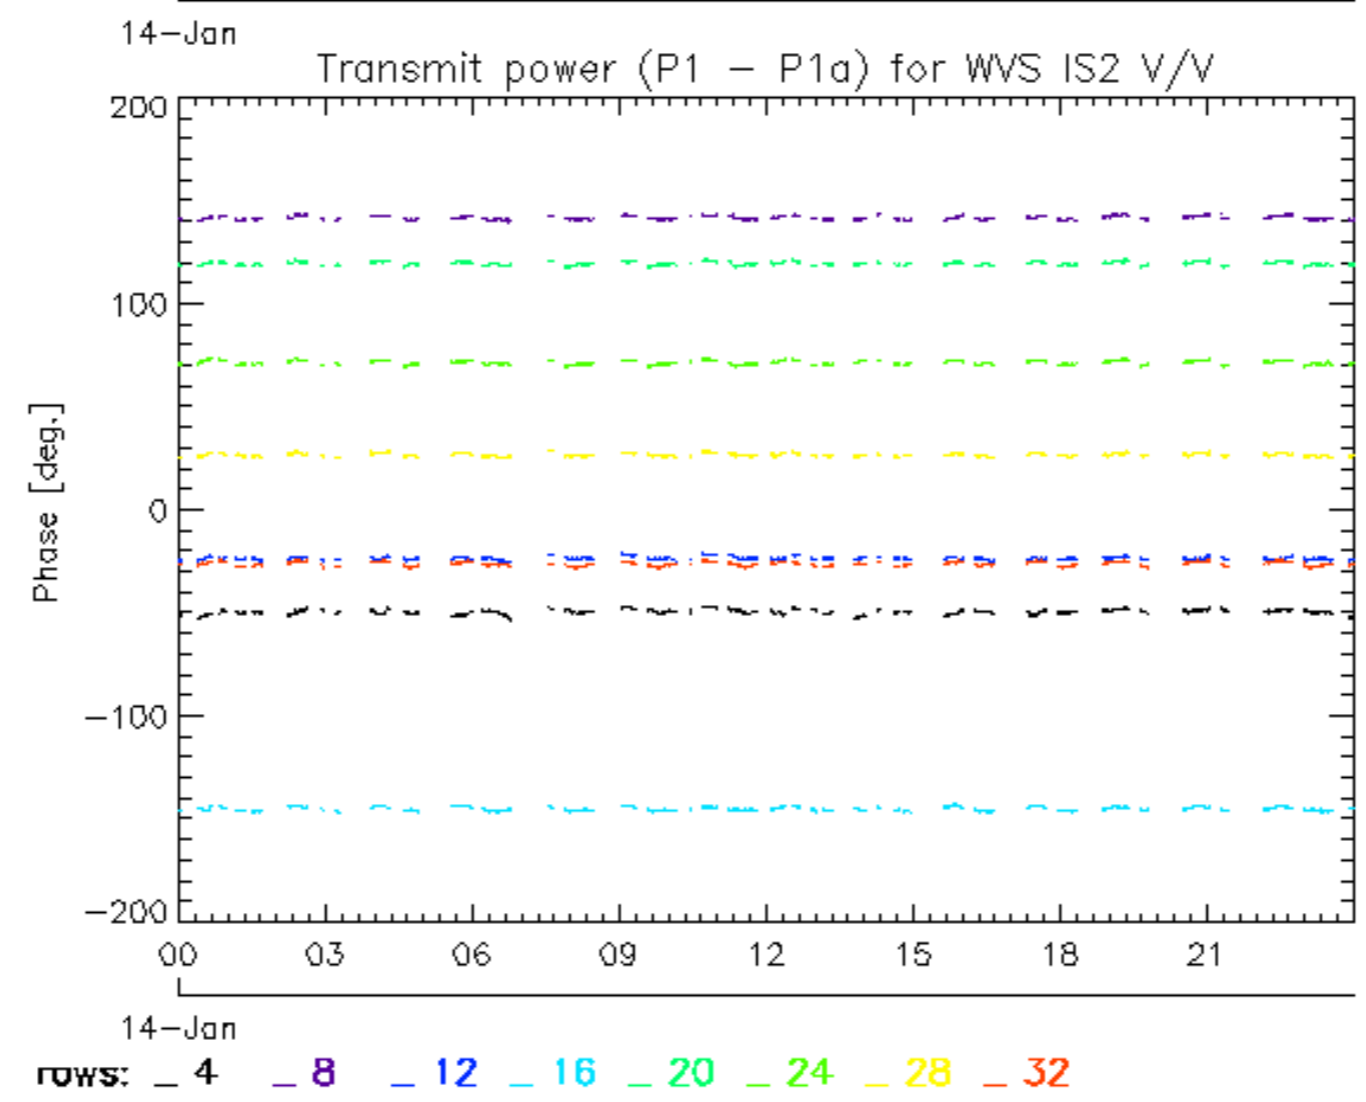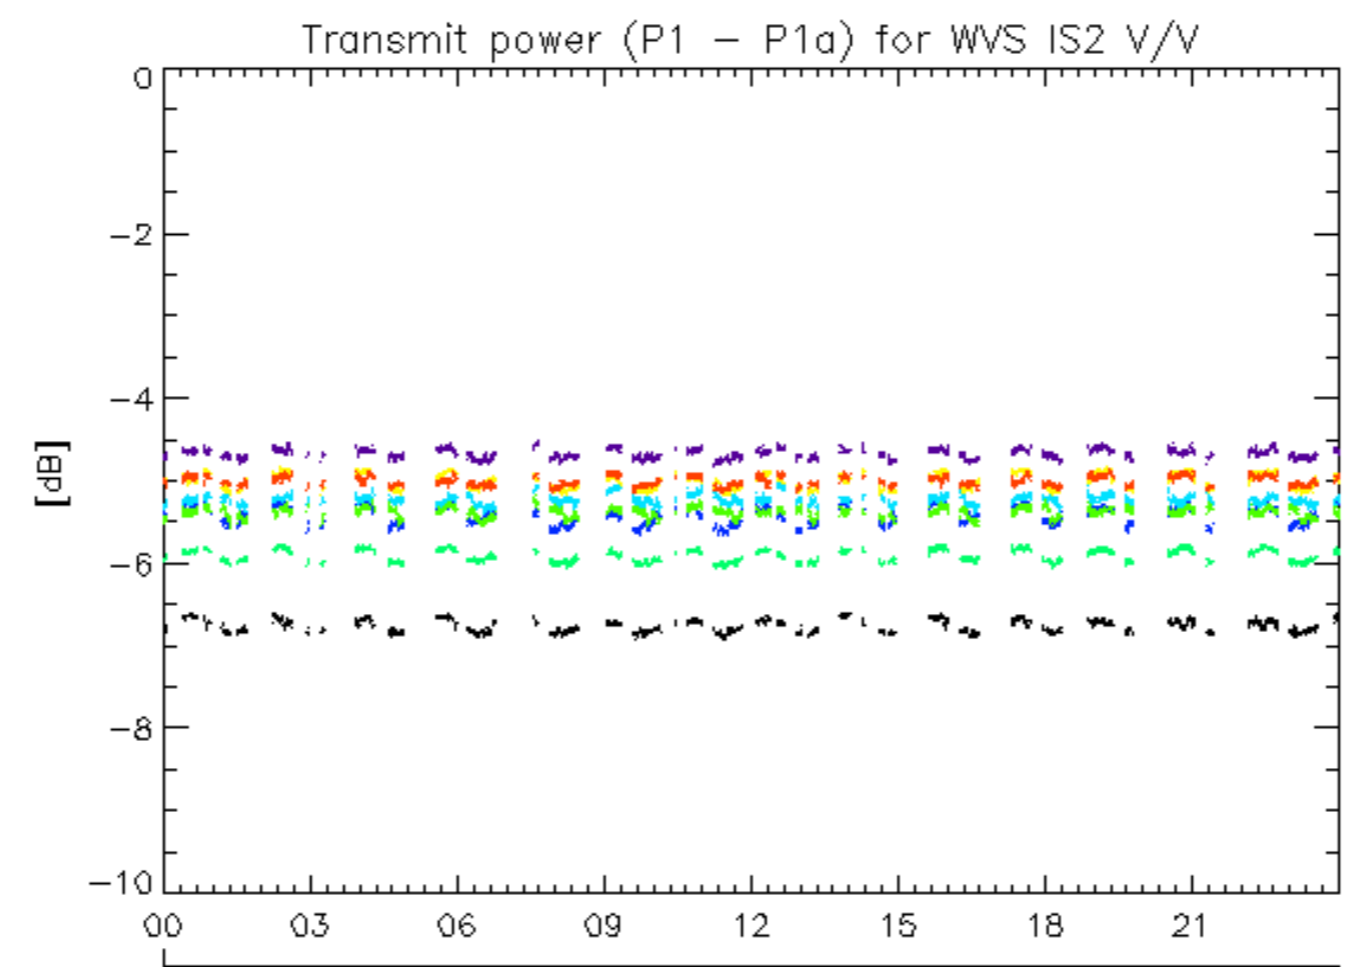


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_GM1_1PNPDE20090114_001223_000006102075_00317_35942_6107.N1						SS1	H/H	75	35942	317	4.07
ASA_GM1_1PNPDE20090114_004225_000003682075_00317_35942_6109.N1						SS1	H/H	75	35942	317	4.07
ASA_GM1_1PNPDE20090114_005739_000002412075_00317_35942_6111.N1						SS1	H/H	75	35942	317	4.07
ASA_GM1_1PNPDE20090114_010917_000000782075_00317_35942_6129.N1						SS1	H/H	75	35942	317	4.07
ASA_GM1_1PNPDE20090114_012356_000003742075_00317_35942_6259.N1						SS1	H/H	75	35942	317	4.07
ASA_GM1_1PNPDE20090114_014442_000002232075_00318_35943_6266.N1						SS1	H/H	75	35943	318	4.07
ASA_GM1_1PNPDE20090114_015139_000009302075_00318_35943_6279.N1						SS1	H/H	75	35943	318	4.07
ASA_GM1_1PNPDE20090114_024325_000004712075_00318_35943_6409.N1						SS1	H/H	75	35943	318	4.07
ASA_GM1_1PNPDE20090114_025800_000001202075_00318_35943_6428.N1						SS1	H/H	75	35943	318	4.07
ASA_GM1_1PNPDE20090114_030007_000001322075_00318_35943_6426.N1						SS1	H/H	75	35943	318	4.07
ASA_GM1_1PNPDE20090114_030305_000002772075_00318_35943_6424.N1						SS1	H/H	75	35943	318	4.07
ASA_GM1_1PNPDE20090114_030911_000002172075_00318_35943_6422.N1						SS1	H/H	75	35943	318	4.07
ASA_GM1_1PNPDE20090114_031650_000008152075_00319_35944_7111.N1						SS1	H/H	75	35944	319	4.07
ASA_GM1_1PNPDE20090114_033116_000009302075_00319_35944_6461.N1						SS1	H/H	75	35944	319	4.07
ASA_GM1_1PNPDE20090114_042001_000001992075_00319_35944_6575.N1						SS1	H/H	75	35944	319	4.07
ASA_GM1_1PNPDE20090114_043029_000000782075_00319_35944_6577.N1						SS1	H/H	75	35944	319	4.07
ASA_GM1_1PNPDE20090114_045501_000006522075_00320_35945_6581.N1						SS1	H/H	75	35945	320	4.07
ASA_GM1_1PNPDE20090114_050710_000006762075_00320_35945_6583.N1						SS1	H/H	75	35945	320	4.07
ASA_GM1_1PNPDE20090114_052201_000002112075_00320_35945_6587.N1						SS1	H/H	75	35945	320	4.07
ASA_GM1_1PNPDE20090114_052718_000004222075_00320_35945_6621.N1						SS1	H/H	75	35945	320	4.07
ASA_GM1_1PNPDE20090114_055927_000002112075_00320_35945_6736.N1						SS1	H/H	75	35945	320	4.07
ASA_GM1_1PNPDE20090114_060437_000004712075_00320_35945_6759.N1						SS1	H/H	75	35945	320	4.07
ASA_GM1_1PNPDE20090114_064712_000006222075_00321_35946_6796.N1						SS1	H/H	75	35946	321	4.07
ASA_GM1_1PNPDE20090114_070909_000004712075_00321_35946_6792.N1						SS1	H/H	75	35946	321	4.07
ASA_GM1_1PNPDE20090114_072013_000001022075_00321_35946_6785.N1						SS1	H/H	75	35946	321	4.07
ASA_GM1_1PNPDE20090114_072244_000000782075_00321_35946_6794.N1						SS1	H/H	75	35946	321	4.07
ASA_GM1_1PNPDE20090114_072557_000001142075_00321_35946_6798.N1						SS1	H/H	75	35946	321	4.07
ASA_GM1_1PNPDK20090114_074003_000005432075_00321_35946_6478.N1						SS1	H/H	75	35946	321	4.07
ASA_GM1_1PNPDK20090114_075144_000000782075_00321_35946_6483.N1						SS1	H/H	75	35946	321	4.07
ASA_GM1_1PNPDK20090114_082759_000006582075_00322_35947_6493.N1						SS1	H/H	75	35947	322	4.07
ASA_GM1_1PNPDK20090114_083741_000001872075_00322_35947_6563.N1						SS1	H/H	75	35947	322	4.07
ASA_GM1_1PNPDK20090114_084919_000001382075_00322_35947_6565.N1						SS1	H/H	75	35947	322	4.07
ASA_GM1_1PNPDK20090114_092039_000004832075_00322_35947_6567.N1						SS1	H/H	75	35947	322	4.07
ASA_GM1_1PNPDK20090114_093125_000001322075_00322_35947_6569.N1						SS1	H/H	75	35947	322	4.07
ASA_GM1_1PNPDK20090114_100919_000003742075_00323_35948_6579.N1						SS1	H/H	75	35948	323	4.07
ASA_GM1_1PNPDK20090114_102152_000001752075_00323_35948_6700.N1						SS1	H/H	75	35948	323	4.07
ASA_GM1_1PNPDK20090114_102952_000001442075_00323_35948_6708.N1						SS1	H/H	75	35948	323	4.07
ASA_GM1_1PNPDK20090114_114917_000005372075_00324_35949_6718.N1						SS1	H/H	75	35949	324	4.07
ASA_GM1_1PNPDK20090114_115712_000000902075_00324_35949_6830.N1						SS1	H/H	75	35949	324	4.07
ASA_GM1_1PNPDK20090114_124514_000005732075_00324_35949_6834.N1						SS1	H/H	75	35949	324	4.07
ASA_GM1_1PNPDK20090114_130216_000002772075_00324_35949_6832.N1						SS1	H/H	75	35949	324	4.07
ASA_GM1_1PNPDK20090114_130644_000001992075_00324_35949_6845.N1						SS1	H/H	75	35949	324	4.07
ASA_GM1_1PNPDK20090114_132306_000010392075_00325_35950_6927.N1						SS1	H/H	75	35950	325	4.07
ASA_GM1_1PNPDK20090114_133910_000004412075_00325_35950_6983.N1						SS1	H/H	75	35950	325	4.07
ASA_GM1_1PNPDK20090114_140102_000003142075_00325_35950_6985.N1						SS1	H/H	75	35950	325	4.07
ASA_GM1_1PNPDK20090114_140742_000002172075_00325_35950_6987.N1						SS1	H/H	75	35950	325	4.07
ASA_GM1_1PNPDK20090114_141249_000001382075_00325_35950_6992.N1						SS1	H/H	75	35950	325	4.07
ASA_GM1_1PNPDK20090114_142226_000000902075_00325_35950_6994.N1						SS1	H/H	75	35950	325	4.07
ASA_GM1_1PNPDK20090114_142638_000005252075_00325_35950_7002.N1						SS1	H/H	75	35950	325	4.07
ASA_GM1_1PNPDK20090114_144406_000002292075_00325_35950_7004.N1						SS1	H/H	75	35950	325	4.07
ASA_GM1_1PNPDK20090114_145644_000009302075_00326_35951_7014.N1						SS1	H/H	75	35951	326	4.07
ASA_GM1_1PNPDK20090114_152436_000001502075_00326_35951_7126.N1						SS1	H/H	75	35951	326	4.07
ASA_GM1_1PNPDK20090114_152807_000001442075_00326_35951_7124.N1						SS1	H/H	75	35951	326	4.07
ASA_GM1_1PNPDK20090114_153211_000002832075_00326_35951_7131.N1						SS1	H/H	75	35951	326	4.07
ASA_GM1_1PNPDK20090114_154007_000000782075_00326_35951_7133.N1						SS1	H/H	75	35951	326	4.07
ASA_GM1_1PNPDK20090114_160302_000007792075_00326_35951_7140.N1						SS1	H/H	75	35951	326	4.07
ASA_GM1_1PNPDK20090114_163831_000001572075_00327_35952_7138.N1						SS1	H/H	75	35952	327	4.07
ASA_GM1_1PNPDK20090114_164403_000002772075_00327_35952_7142.N1						SS1	H/H	75	35952	327	4.07
ASA_GM1_1PNPDK20090114_170126_000001382075_00327_35952_7255.N1						SS1	H/H	75	35952	327	4.07
ASA_GM1_1PNPDK20090114_170432_000003922075_00327_35952_7257.N1						SS1	H/H	75	35952	327	4.07
ASA_GM1_1PNPDK20090114_171502_000001932075_00327_35952_7259.N1						SS1	H/H	75	35952	327	4.07
ASA_GM1_1PNPDK20090114_174338_000004342075_00327_35952_7267.N1						SS1	H/H	75	35952	327	4.07
ASA_GM1_1PNPDK20090114_182317_000001022075_00328_35953_7269.N1						SS1	H/H	75	35953	328	4.07
ASA_GM1_1PNPDK20090114_182856_000001872075_00328_35953_7271.N1						SS1	H/H	75	35953	328	4.07
ASA_GM1_1PNPDK20090114_183044_000000782075_00328_35953_7383.N1						SS1	H/H	75	35953	328	4.07
ASA_GM1_1PNPDK20090114_184136_000003442075_00328_35953_7385.N1						SS1	H/H	75	35953	328	4.07
ASA_GM1_1PNPDK20090114_192414_000003862075_00328_35953_7387.N1						SS1	H/H	75	35953	328	4.07


ASA_GM1_1PNPDK20090114_195057_000008272075_00328_35953_7392.N1	SS1	H/H	75	35953	328	4.07
ASA_GM1_1PNPDK20090114_200828_000001382075_00329_35954_7416.N1	SS1	H/H	75	35954	329	4.07
ASA_GM1_1PNPDE20090114_202103_000004042075_00329_35954_7252.N1	SS1	H/H	75	35954	329	4.07
ASA_GM1_1PNPDE20090114_210450_000001502075_00329_35954_7250.N1	SS1	H/H	75	35954	329	4.07
ASA_GM1_1PNPDE20090114_210902_000000782075_00329_35954_7262.N1	SS1	H/H	75	35954	329	4.07
ASA_GM1_1PNPDE20090114_212701_000011722075_00329_35954_7412.N1	SS1	H/H	75	35954	329	4.07
ASA_GM1_1PNPDE20090114_220040_000004892075_00330_35955_7407.N1	SS1	H/H	75	35955	330	4.07
ASA_GM1_1PNPDE20090114_233954_000003922075_00331_35956_7530.N1	SS1	H/H	75	35956	331	4.07
ASA_GM1_1PNPDE20090114_234908_000002352075_00331_35956_7532.N1	SS1	H/H	75	35956	331	4.07


Filename	Pol	Timestamp	count(Module)
ASA_MS__0PNPDK20090114_073829_000000162075_00321_35946_0722.N1	V	2009-01-14 07:38:29	320







Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20090113_233600_000016942075_00316_35941_6122.N1						IS2	V/V	75	35941	316	4.07
ASA_WVS_1PNPDE20090114_002235_000011472075_00317_35942_6119.N1						IS2	V/V	75	35942	317	4.07
ASA_WVS_1PNPDE20090114_004835_000004952075_00317_35942_6116.N1						IS2	V/V	75	35942	317	4.07
ASA_WVS_1PNPDE20090114_011040_000004492075_00317_35942_6132.N1						IS2	V/V	75	35942	317	4.07
ASA_WVS_1PNPDE20090114_011726_000002692075_00317_35942_6257.N1						IS2	V/V	75	35942	317	4.07
ASA_WVS_1PNPDE20090114_011040_000004492075_00317_35942_6132.N1						IS1	V/V	75	35942	317	4.07
ASA_WVS_1PNPDE20090114_013011_000007492075_00318_35943_6264.N1						IS2	V/V	75	35943	318	4.07
ASA_WVS_1PNPDE20090114_021349_000004042075_00318_35943_6269.N1						IS2	V/V	75	35943	318	4.07
ASA_WVS_1PNPDE20090114_022207_000006892075_00318_35943_6272.N1						IS2	V/V	75	35943	318	4.07
ASA_WVS_1PNPDE20090114_023322_000002252075_00318_35943_6407.N1						IS2	V/V	75	35943	318	4.07
ASA_WVS_1PNPDE20090114_025525_000001052075_00318_35943_6420.N1						IS2	V/V	75	35943	318	4.07
ASA_WVS_1PNPDE20090114_031251_000001942075_00319_35944_6436.N1						IS2	V/V	75	35944	319	4.07
ASA_WVS_1PNPDE20090114_035500_000009892075_00319_35944_6439.N1						IS2	V/V	75	35944	319	4.07
ASA_WVS_1PNPDE20090114_041059_000000902075_00319_35944_6570.N1						IS2	V/V	75	35944	319	4.07
ASA_WVS_1PNPDE20090114_035500_000009892075_00319_35944_6439.N1						IS1	V/V	75	35944	319	4.07
ASA_WVS_1PNPDE20090114_041548_000001202075_00319_35944_6573.N1						IS2	V/V	75	35944	319	4.07
ASA_WVS_1PNPDE20090114_043513_000011392075_00319_35944_6614.N1						IS2	V/V	75	35944	319	4.07
ASA_WVS_1PNPDE20090114_053424_000010192075_00320_35945_6625.N1						IS2	V/V	75	35945	320	4.07
ASA_WVS_1PNPDE20090114_055108_000004502075_00320_35945_6739.N1						IS2	V/V	75	35945	320	4.07
ASA_WVS_1PNPDE20090114_053424_000010192075_00320_35945_6625.N1						IS1	V/V	75	35945	320	4.07
ASA_WVS_1PNPDE20090114_061228_000020392075_00320_35945_6804.N1						IS2	V/V	75	35945	320	4.07
ASA_WVS_1PNPDE20090114_073344_000000452075_00321_35946_6801.N1						IS2	V/V	75	35946	321	4.07
ASA_WVS_1PNPDK20090114_073414_000002102075_00321_35946_6476.N1						IS2	V/V	75	35946	321	4.07
ASA_WVS_1PNPDK20090114_075304_000013792075_00321_35946_6481.N1						IS2	V/V	75	35946	321	4.07
ASA_WVS_1PNPDK20090114_081739_000005692075_00322_35947_6491.N1						IS2	V/V	75	35947	322	4.07
ASA_WVS_1PNPDK20090114_090310_000010042075_00322_35947_6577.N1						IS2	V/V	75	35947	322	4.07
ASA_WVS_1PNPDK20090114_093340_000020842075_00322_35947_6587.N1						IS2	V/V	75	35947	322	4.07
ASA_WVS_1PNPDK20090114_100840_000000002075_00322_35947_6590.N1						IS2	V/V	75	35947	322	4.07
ASA_WVS_1PNPDK20090114_102621_000000602075_00323_35948_6703.N1						IS2	V/V	75	35948	323	4.07
ASA_WVS_1PNPDK20090114_104054_000011542075_00323_35948_6706.N1						IS2	V/V	75	35948	323	4.07
ASA_WVS_1PNPDK20090114_111412_000020542075_00323_35948_6716.N1						IS2	V/V	75	35948	323	4.07
ASA_WVS_1PNPDK20090114_120622_000002852075_00324_35949_6819.N1						IS2	V/V	75	35949	324	4.07
ASA_WVS_1PNPDK20090114_121323_000005692075_00324_35949_6828.N1						IS2	V/V	75	35949	324	4.07
ASA_WVS_1PNPDK20090114_123142_000005702075_00324_35949_6837.N1						IS2	V/V	75	35949	324	4.07
ASA_WVS_1PNPDK20090114_125452_000004052075_00324_35949_6840.N1						IS2	V/V	75	35949	324	4.07
ASA_WVS_1PNPDK20090114_131006_000005092075_00324_35949_6843.N1						IS2	V/V	75	35949	324	4.07
ASA_WVS_1PNPDK20090114_131939_000001642075_00325_35950_6854.N1						IS2	V/V	75	35950	325	4.07
ASA_WVS_1PNPDK20090114_134827_000000452075_00325_35950_6981.N1						IS2	V/V	75	35950	325	4.07
ASA_WVS_1PNPDK20090114_135041_000005842075_00325_35950_6990.N1						IS2	V/V	75	35950	325	4.07
ASA_WVS_1PNPDK20090114_141512_000001652075_00325_35950_6997.N1						IS2	V/V	75	35950	325	4.07
ASA_WVS_1PNPDK20090114_143528_000004802075_00325_35950_7000.N1						IS2	V/V	75	35950	325	4.07
ASA_WVS_1PNPDK20090114_144759_000004792075_00325_35950_7007.N1						IS2	V/V	75	35950	325	4.07
ASA_WVS_1PNPDK20090114_153659_000001492075_00326_35951_7129.N1						IS2	V/V	75	35951	326	4.07
ASA_WVS_1PNPDK20090114_154129_000012442075_00326_35951_7136.N1						IS2	V/V	75	35951	326	4.07
ASA_WVS_1PNPDK20090114_161604_000013042075_00326_35951_7145.N1						IS2	V/V	75	35951	326	4.07
ASA_WVS_1PNPDK20090114_171818_000014692075_00327_35952_7265.N1						IS2	V/V	75	35952	327	4.07
ASA_WVS_1PNPDK20090114_175636_000001202075_00327_35952_7262.N1						IS2	V/V	75	35952	327	4.07
ASA_WVS_1PNPDK20090114_180043_000011092075_00327_35952_7279.N1						IS2	V/V	75	35952	327	4.07
ASA_WVS_1PNPDK20090114_185226_000018592075_00328_35953_7390.N1						IS2	V/V	75	35953	328	4.07
ASA_WVS_1PNPDK20090114_193711_000006902075_00328_35953_7409.N1						IS2	V/V	75	35953	328	4.07
ASA_WVS_1PNPDE20090114_203000_000020392075_00329_35954_7255.N1						IS2	V/V	75	35954	329	4.07
ASA_WVS_1PNPDE20090114_211827_000002842075_00329_35954_7265.N1						IS2	V/V	75	35954	329	4.07
ASA_WVS_1PNPDE20090114_212227_000001502075_00329_35954_7390.N1						IS2	V/V	75	35954	329	4.07
ASA_WVS_1PNPDE20090114_211827_000002842075_00329_35954_7265.N1						IS1	V/V	75	35954	329	4.07
ASA_WVS_1PNPDE20090114_220849_000001202075_00330_35955_7397.N1						IS2	V/V	75	35955	330	4.07
ASA_WVS_1PNPDE20090114_221244_000018892075_00330_35955_7400.N1						IS2	V/V	75	35955	330	4.07
ASA_WVS_1PNPDE20090114_225823_000004642075_00330_35955_7410.N1						IS2	V/V	75	35955	330	4.07
ASA_WVS_1PNPDE20090114_230508_000016492075_00330_35955_7535.N1						IS2	V/V	75	35955	330	4.07
ASA_WVS_1PNPDE20090114_225823_000004642075_00330_35955_7410.N1						IS1	V/V	75	35955	330	4.07
ASA_WVS_1PNPDE20090114_235308_000009892075_00331_35956_7538.N1						IS2	V/V	75	35956	331	4.07



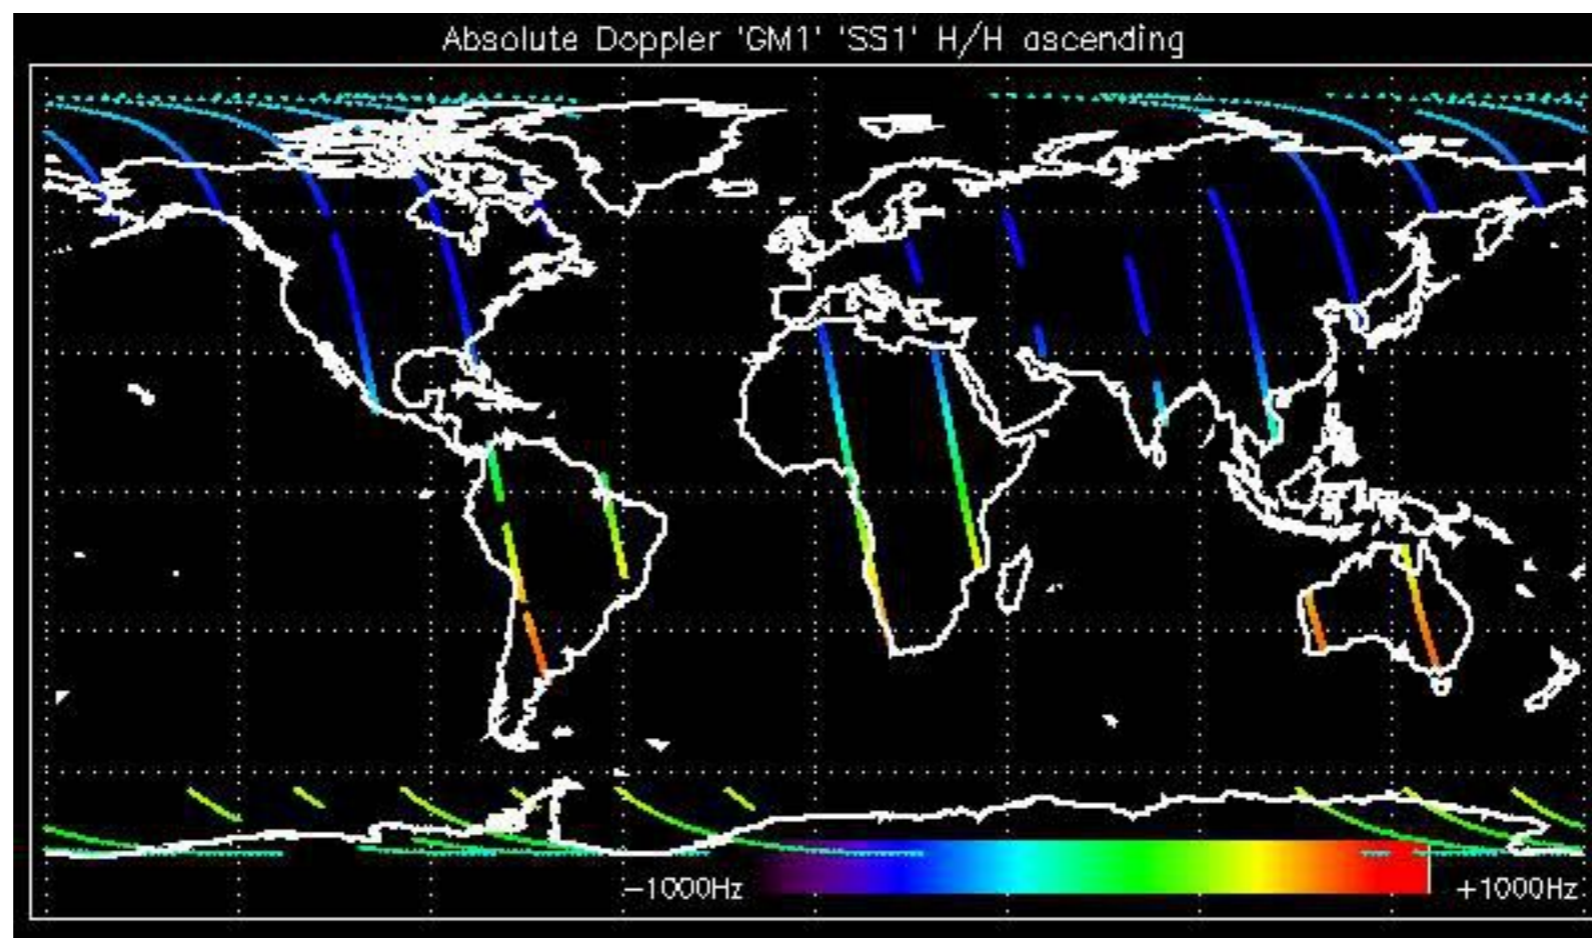


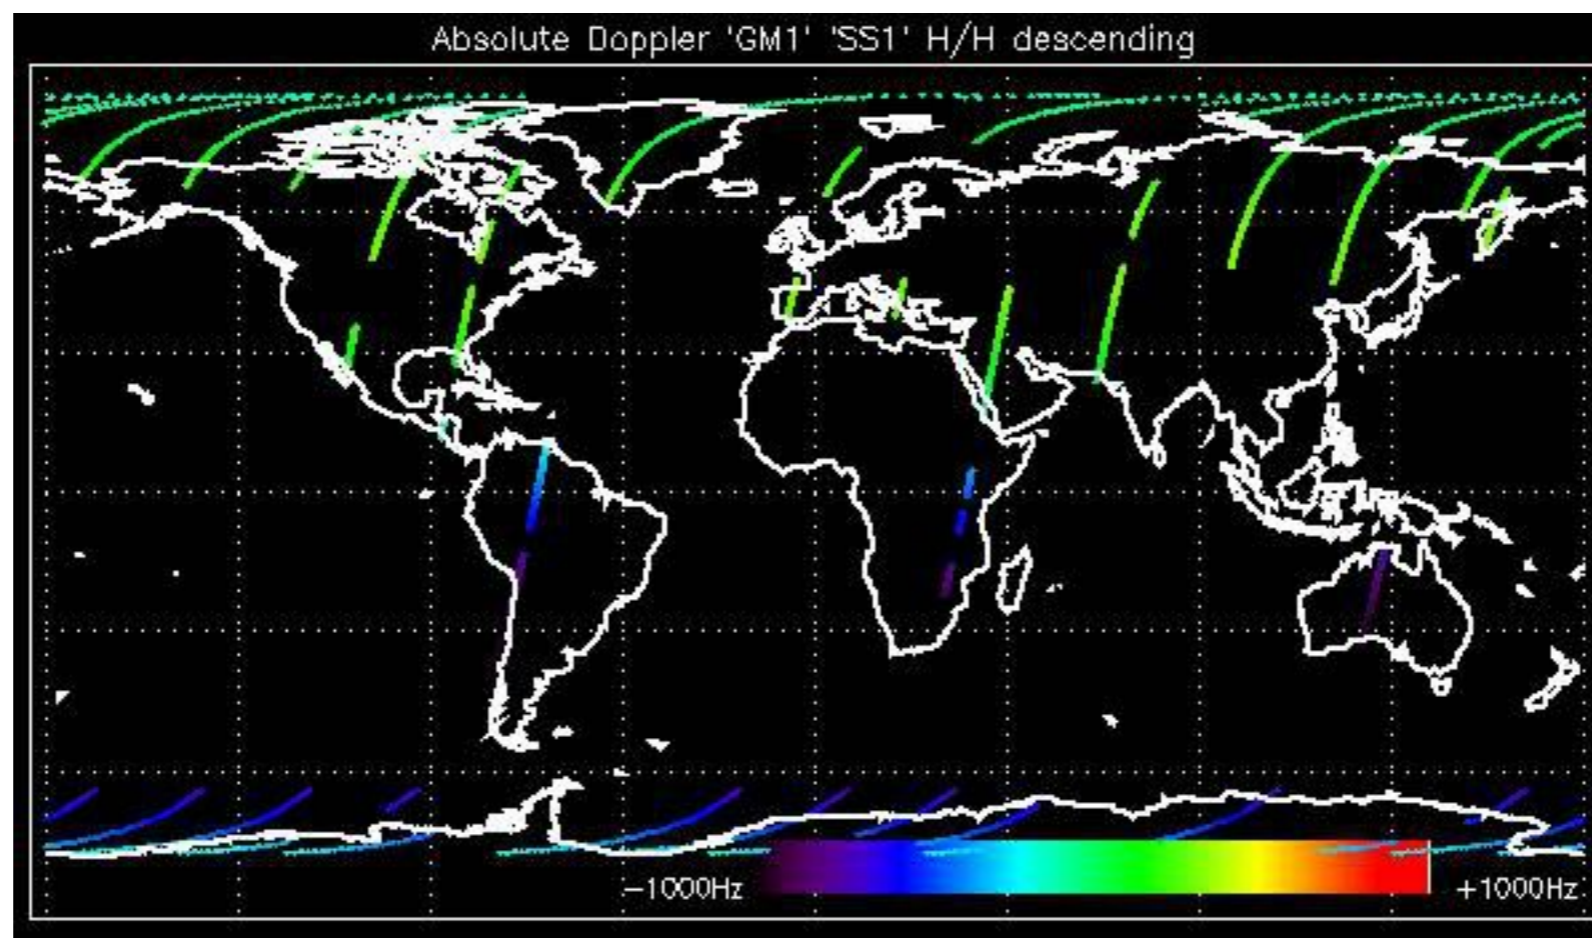


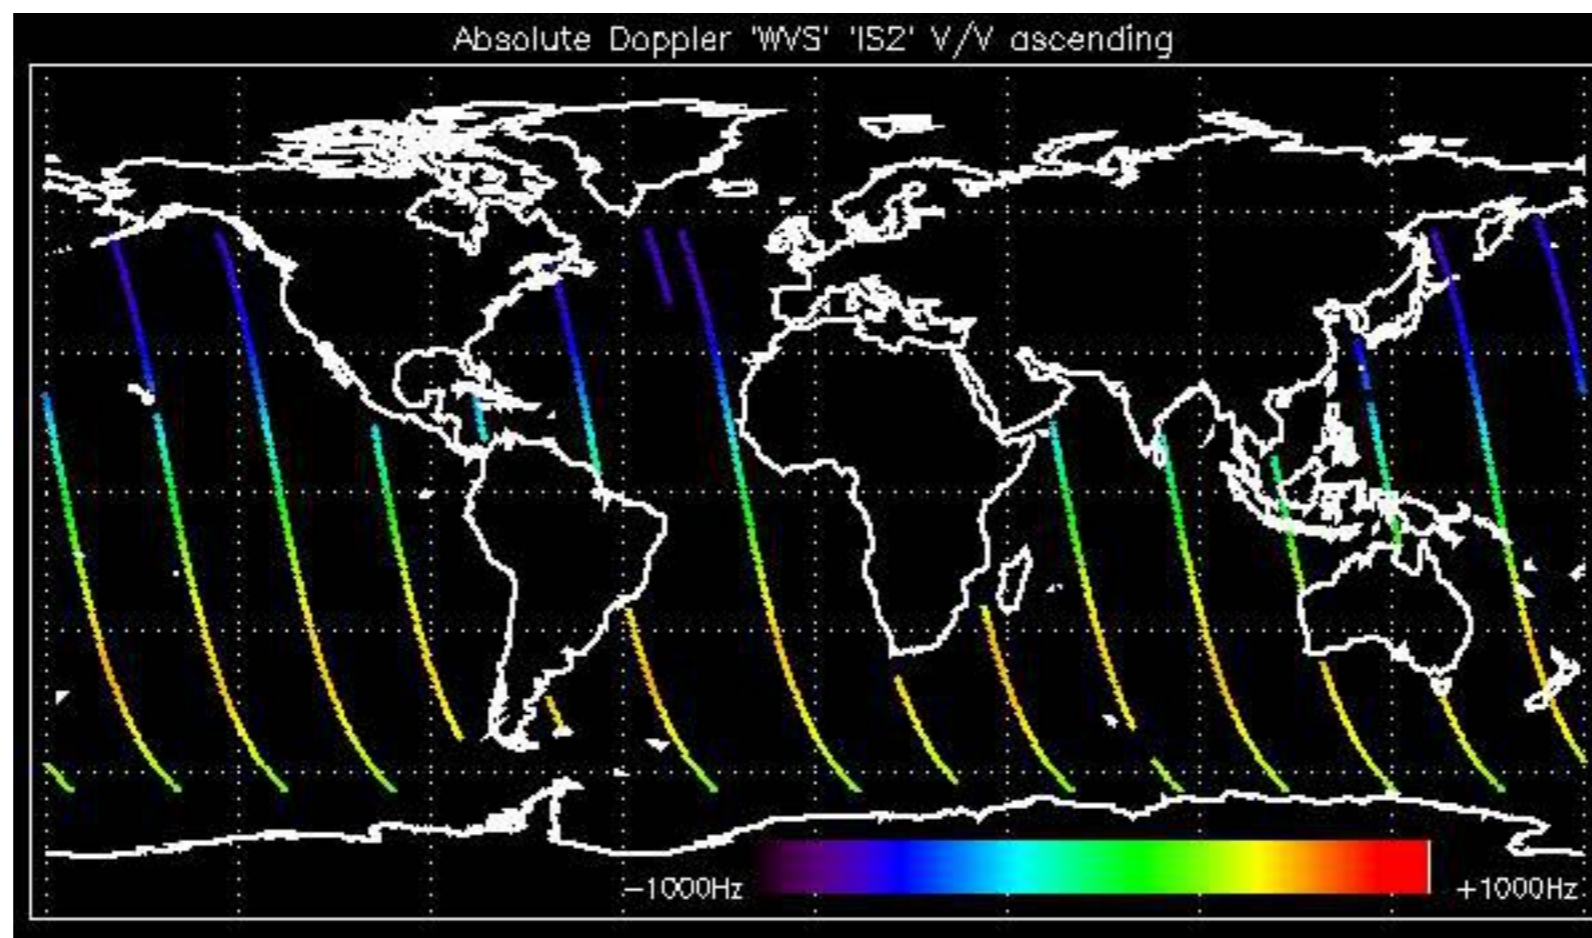


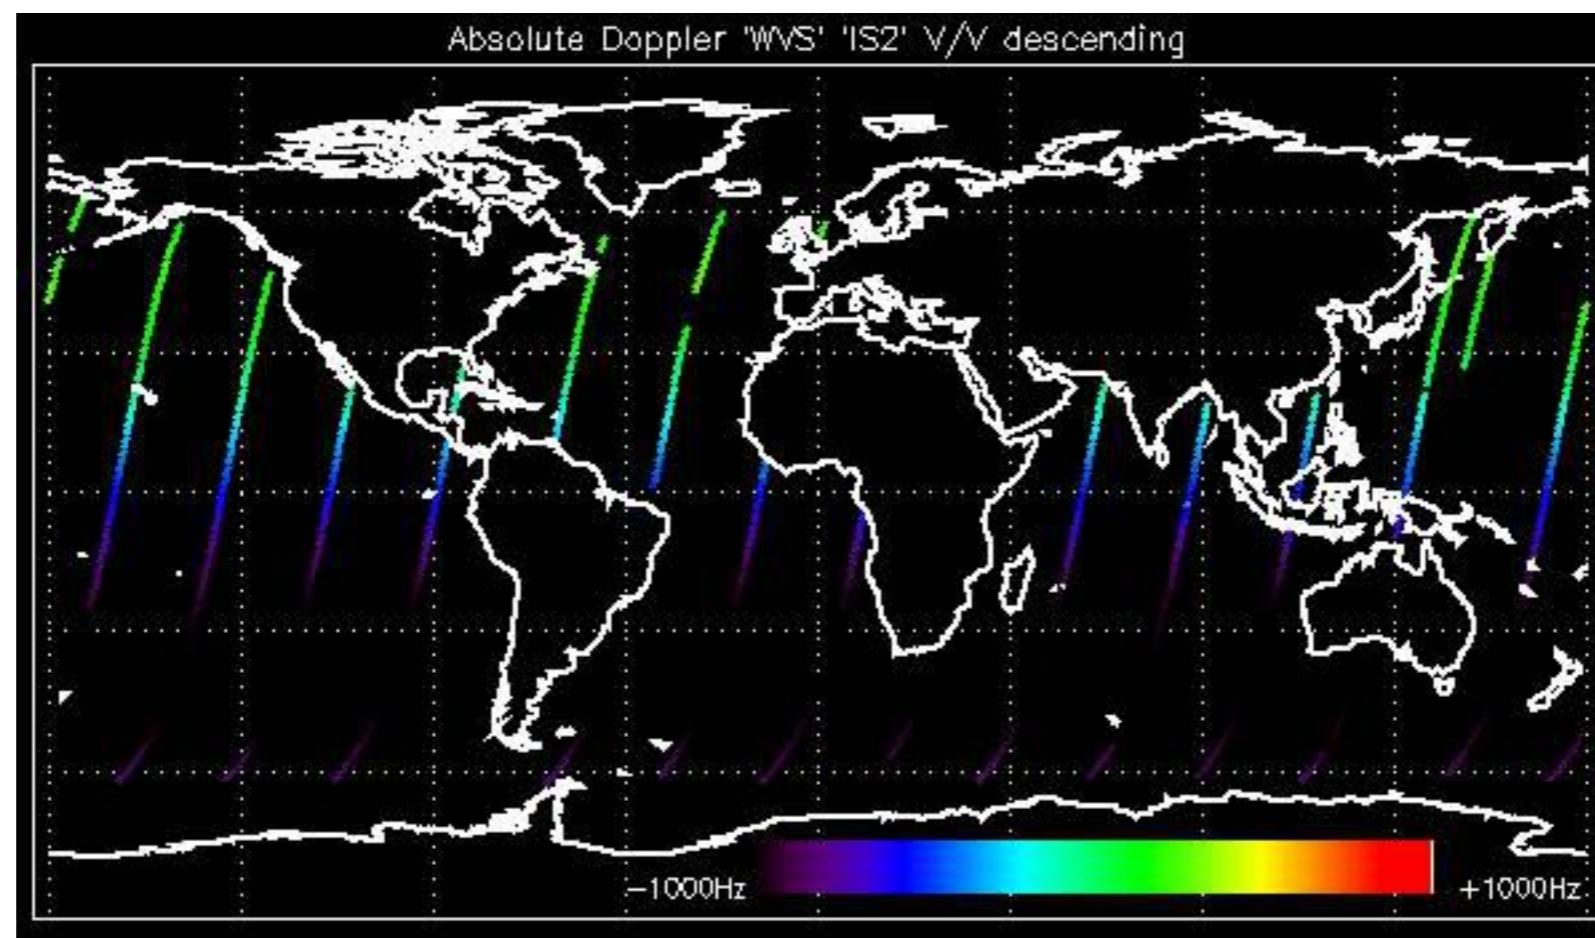


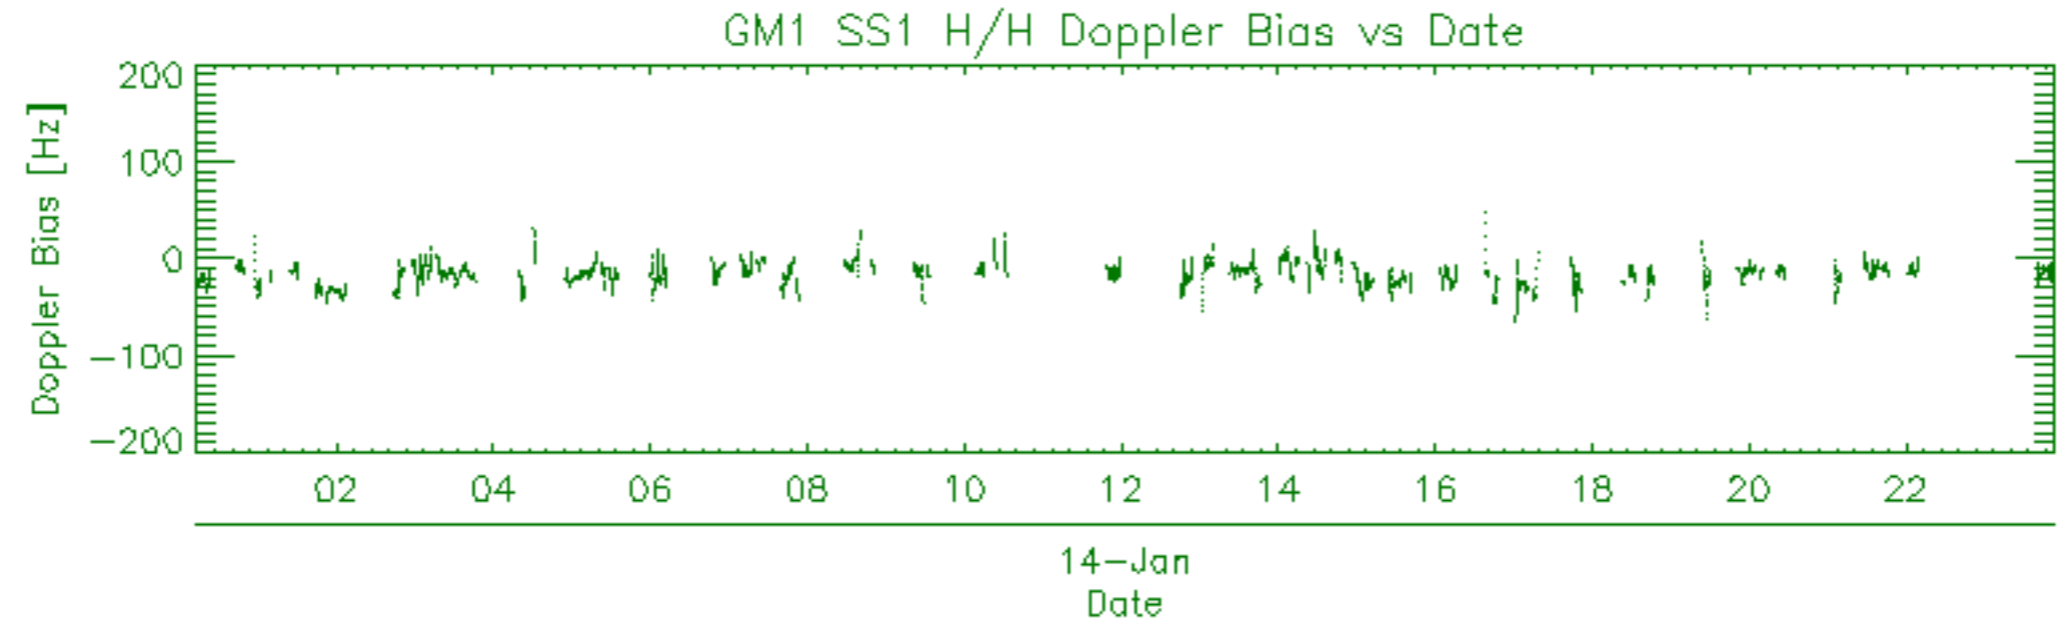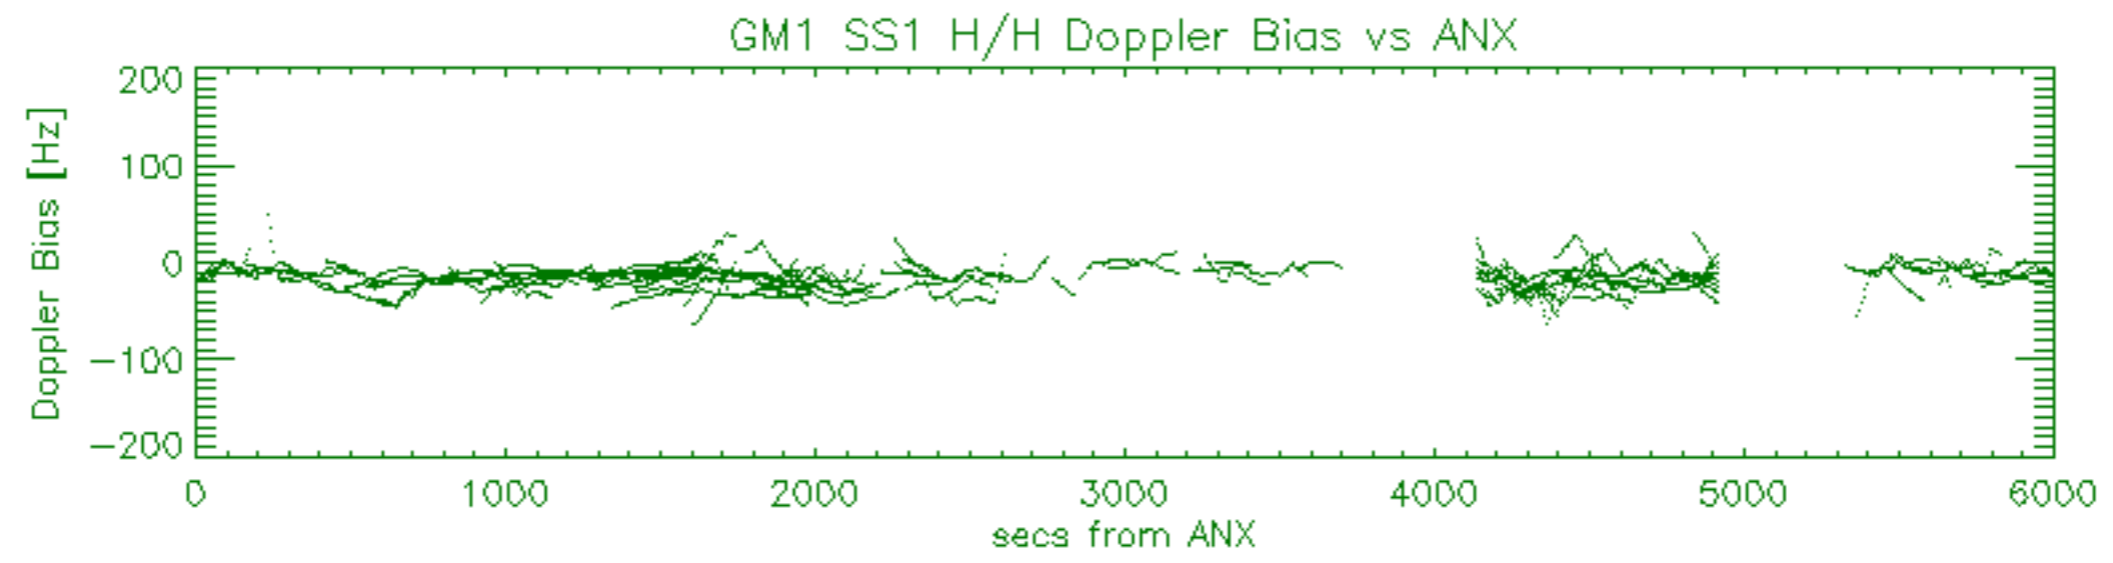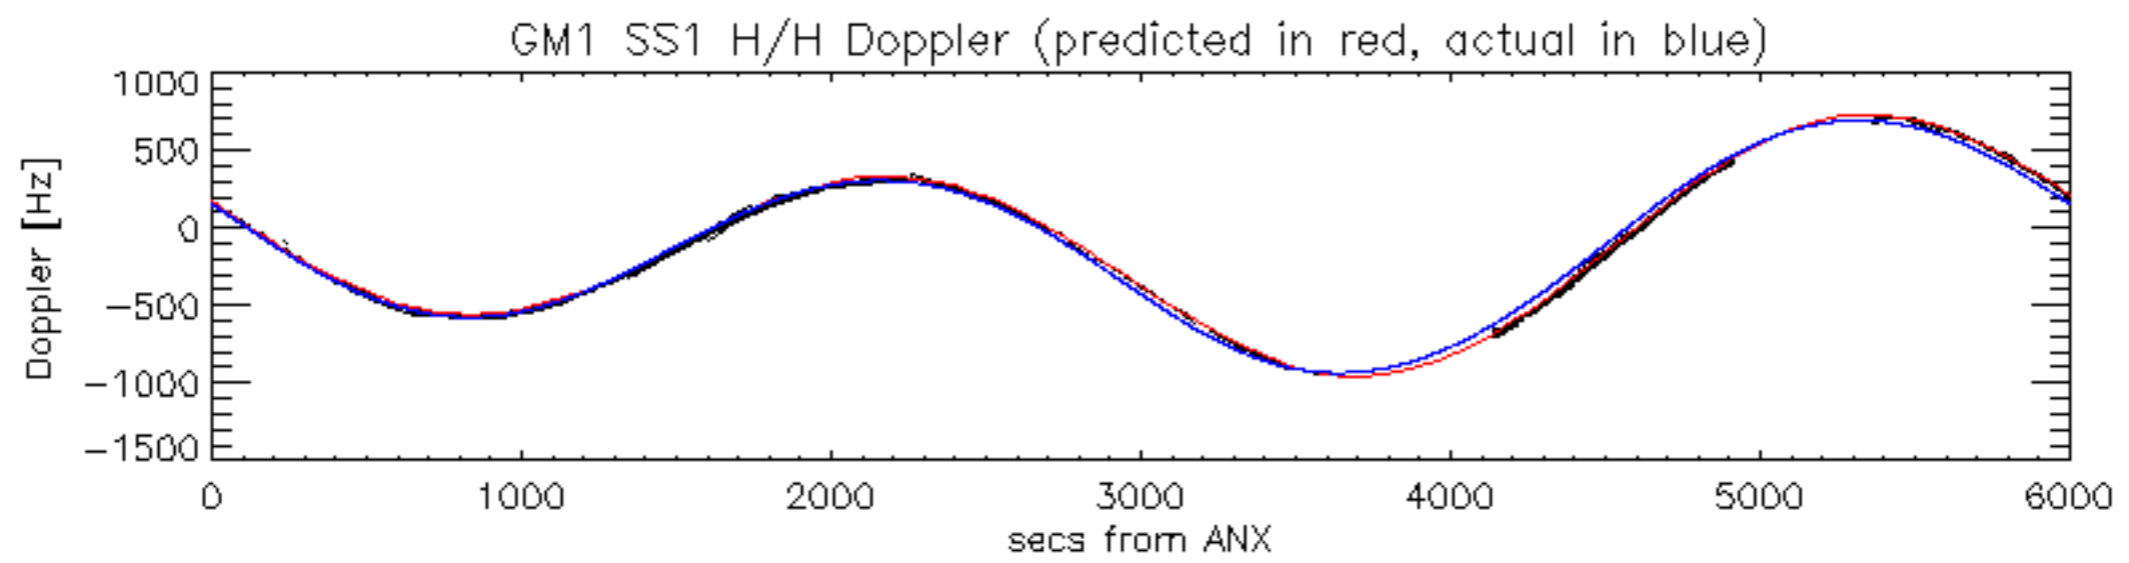


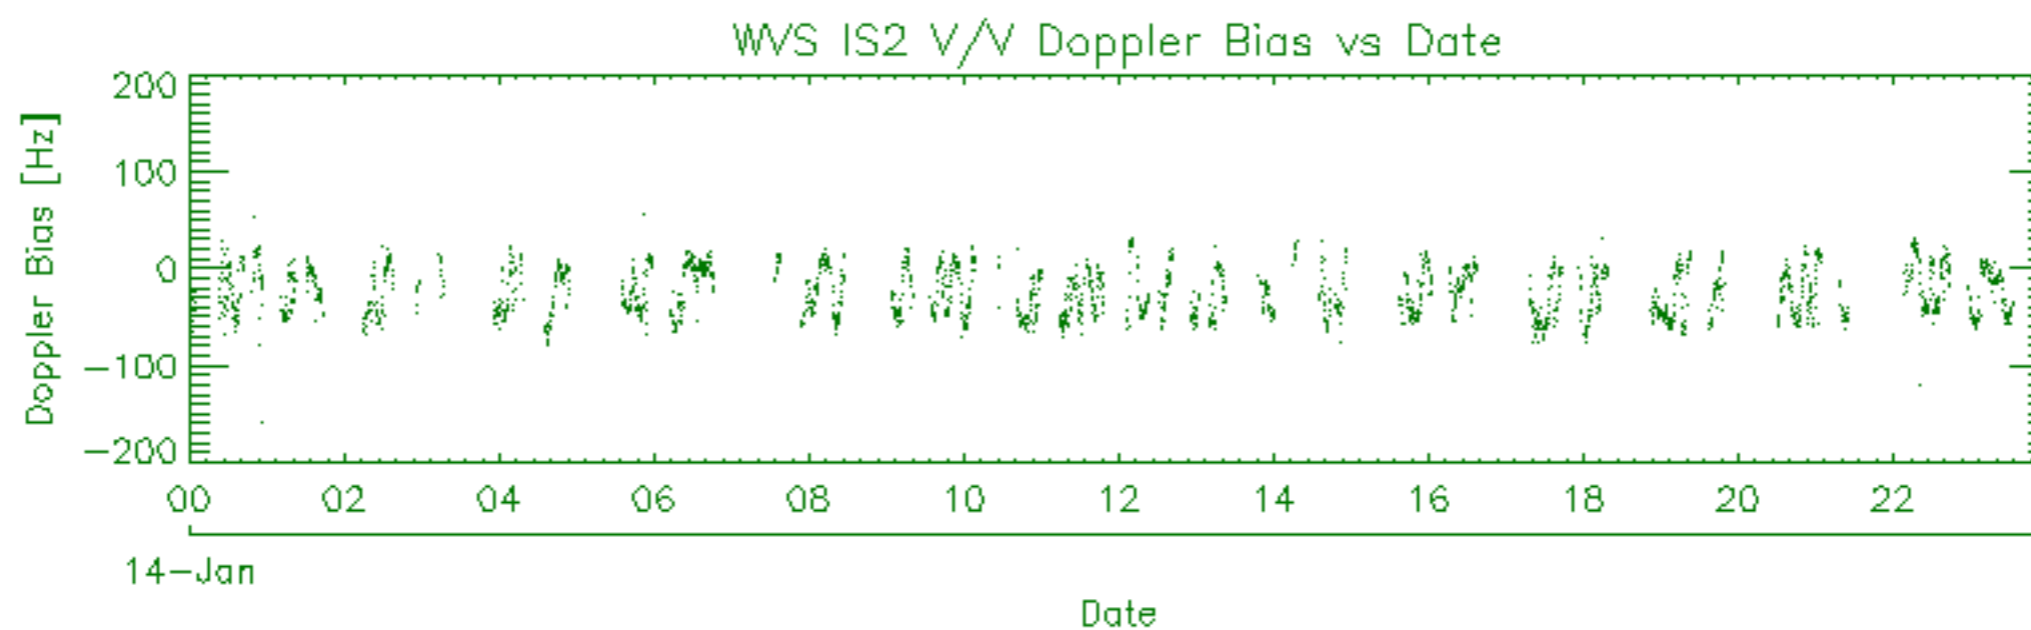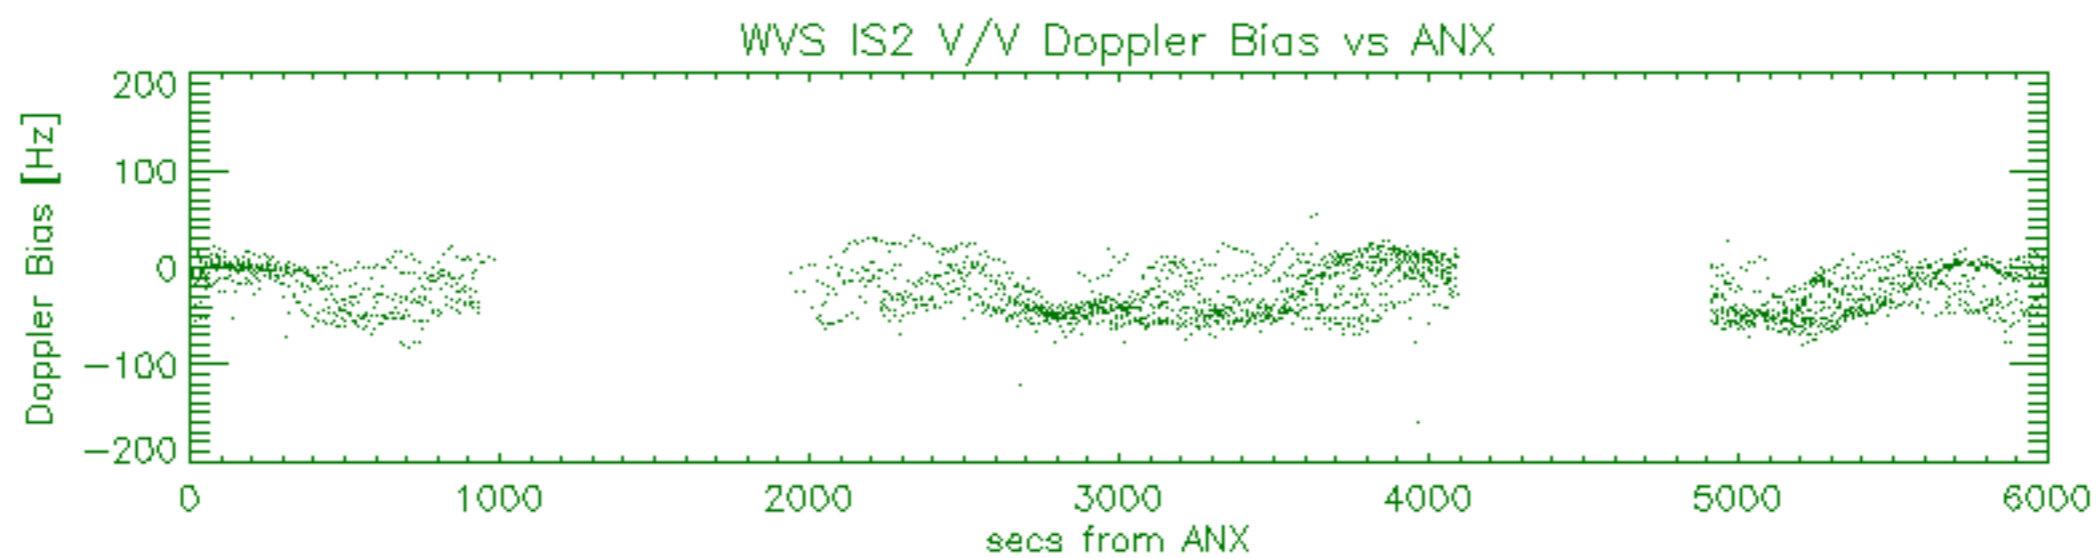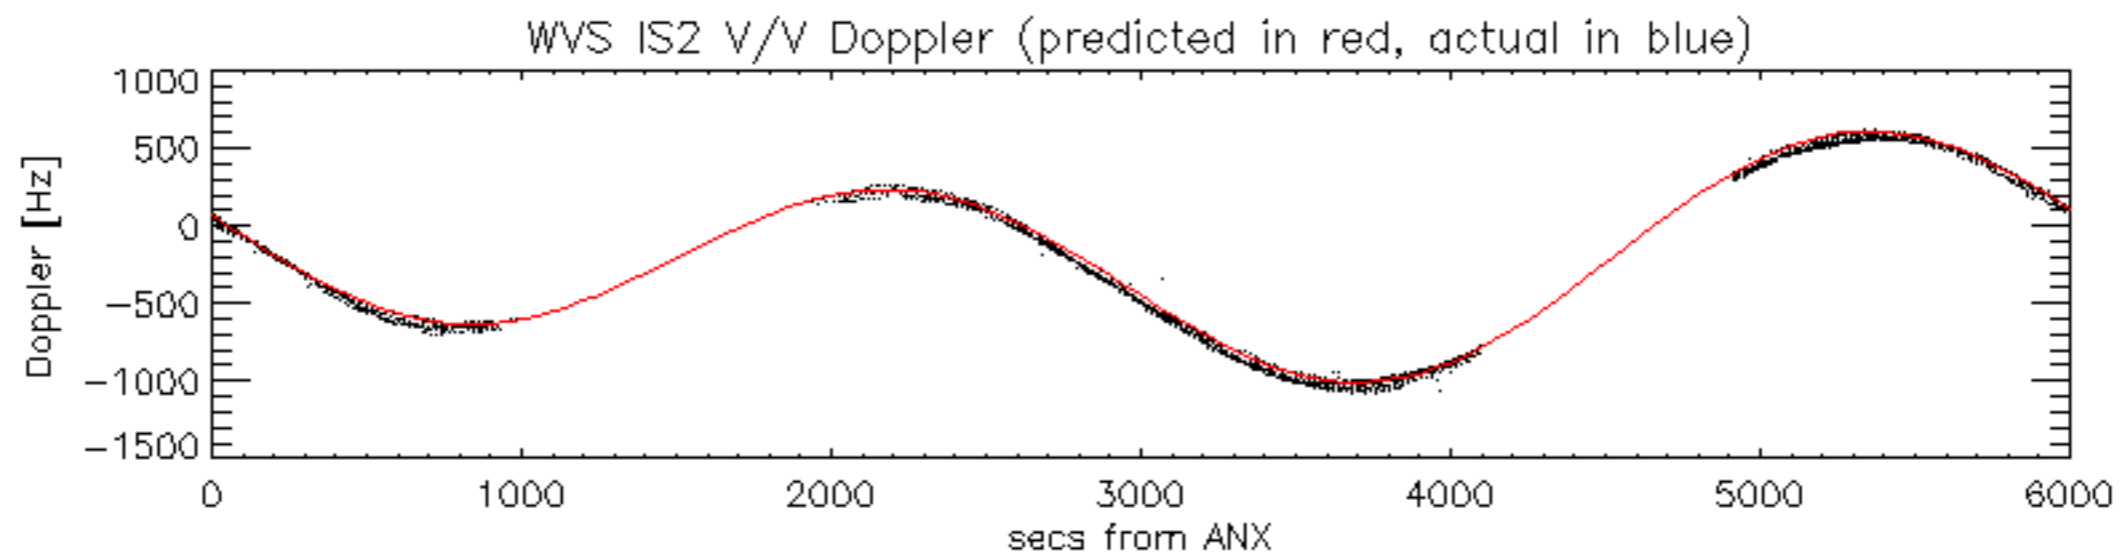


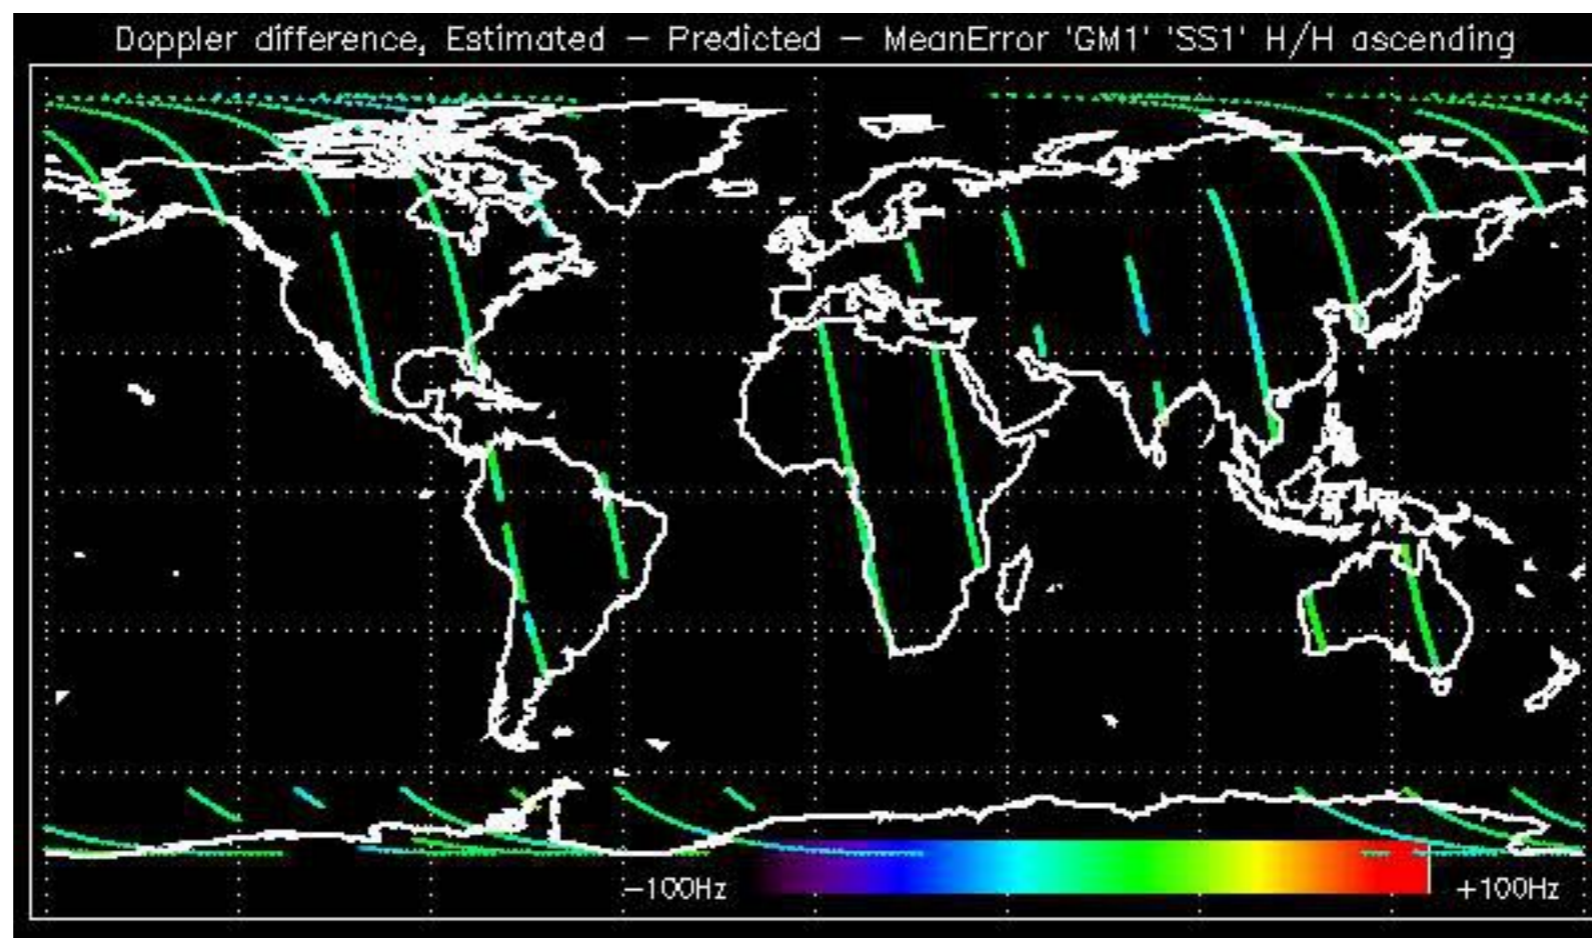


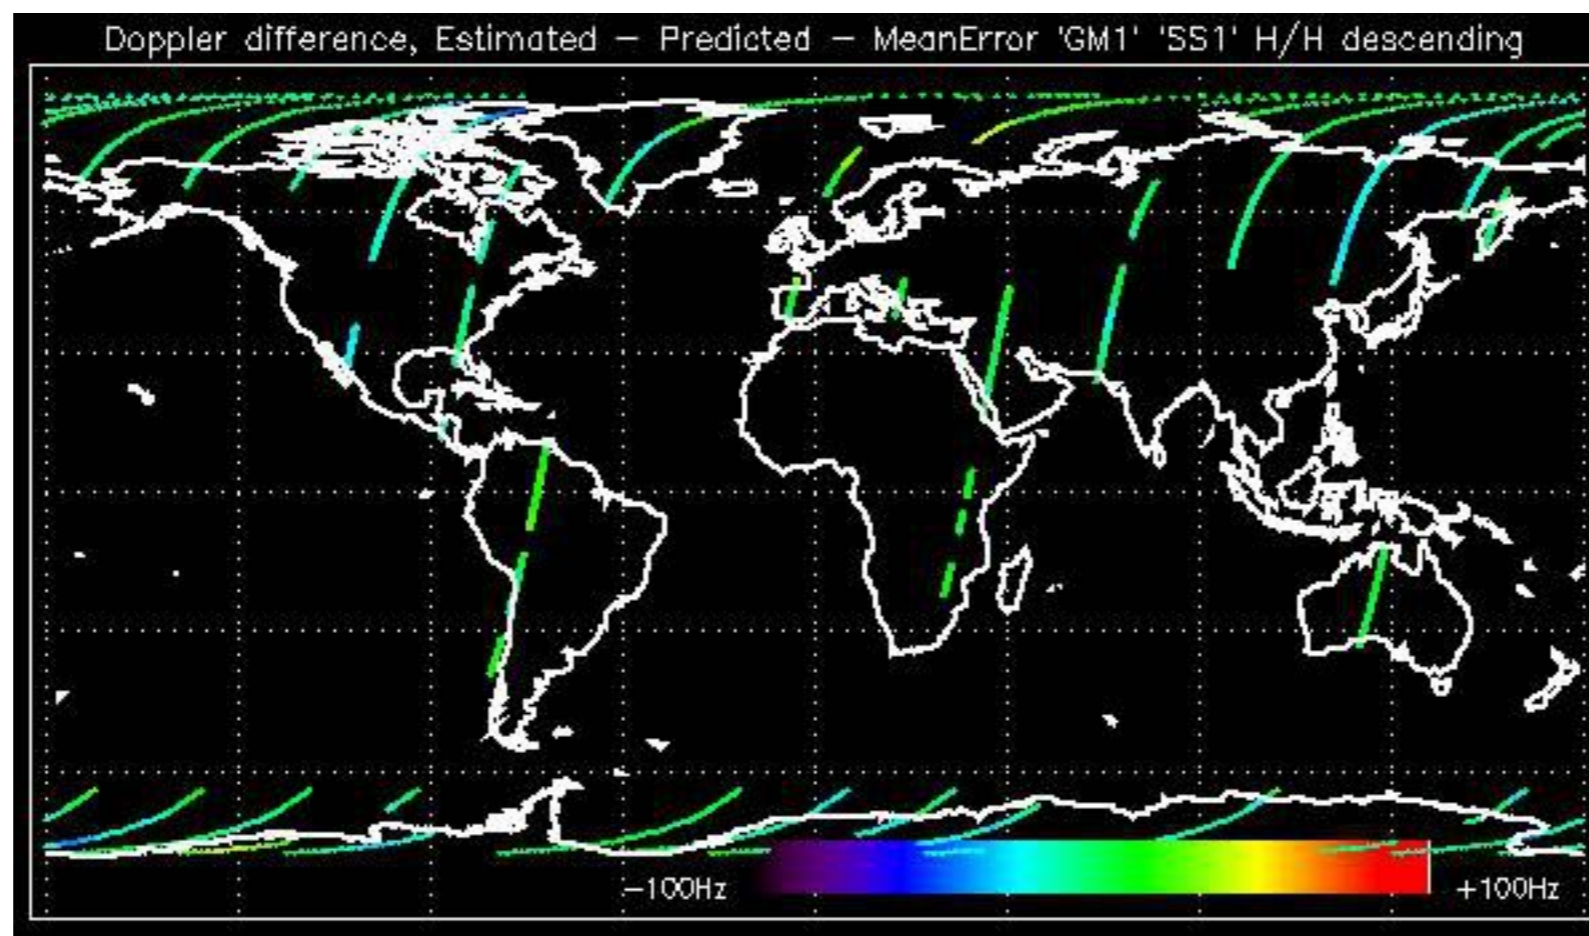

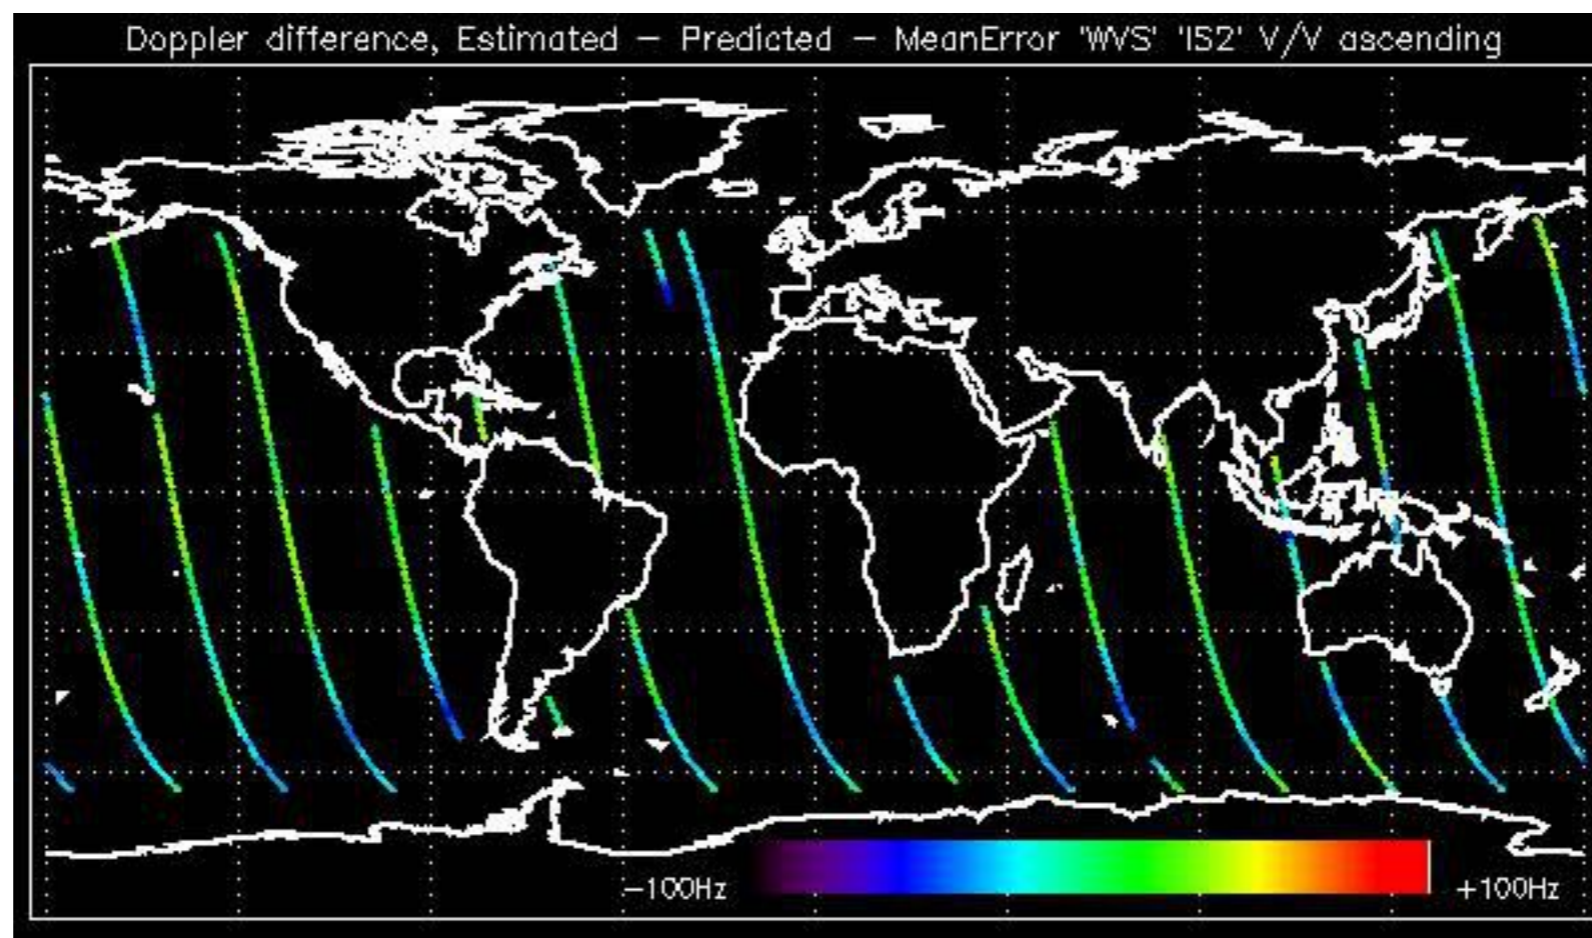


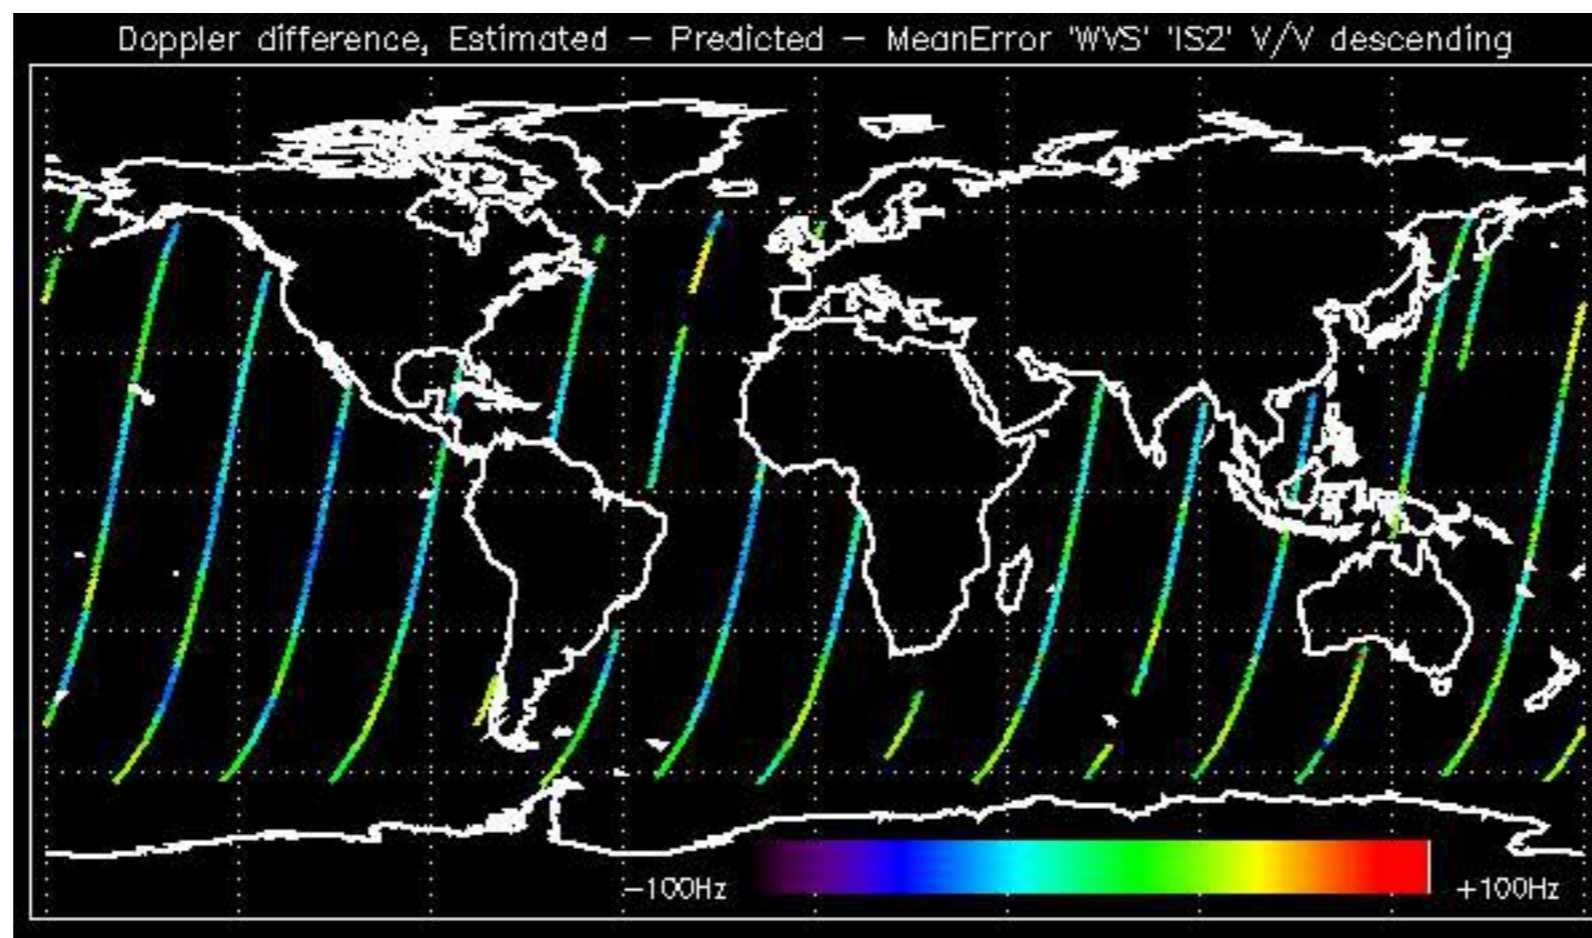

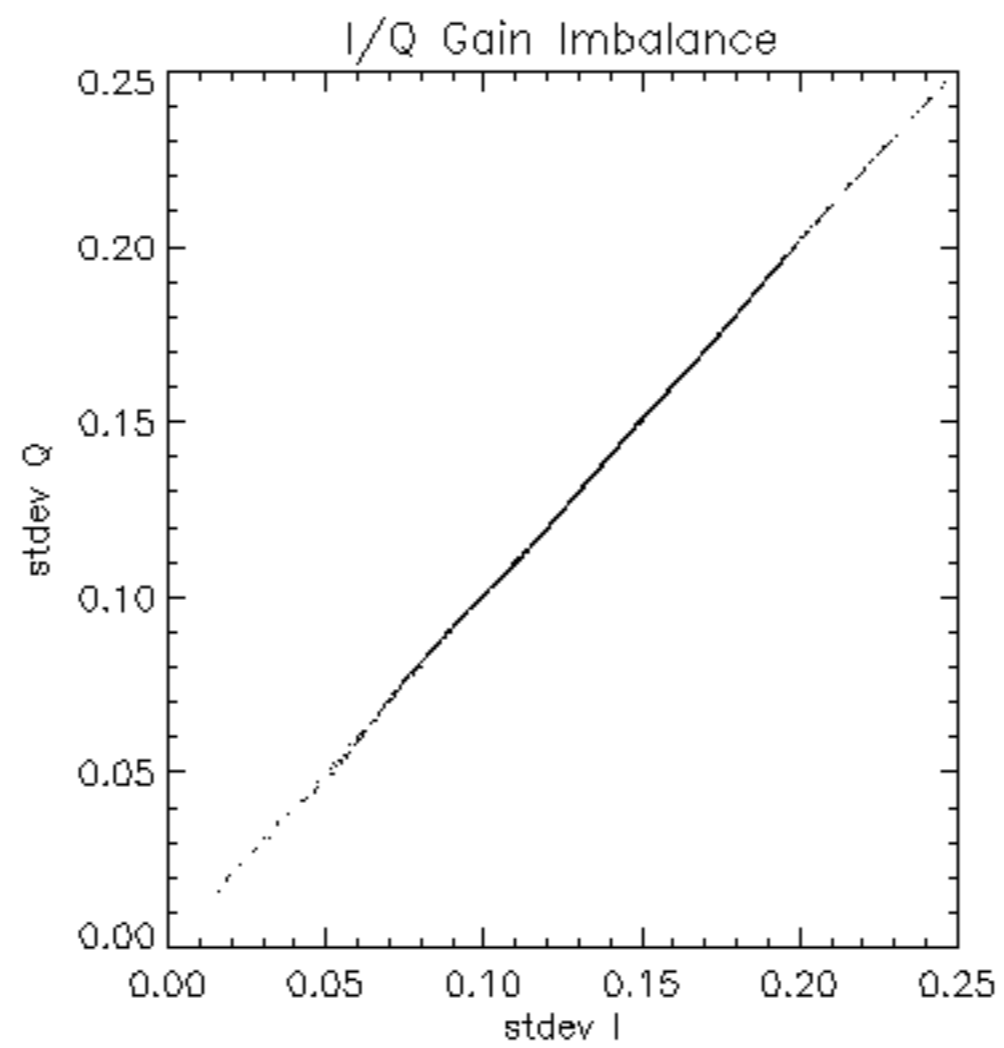


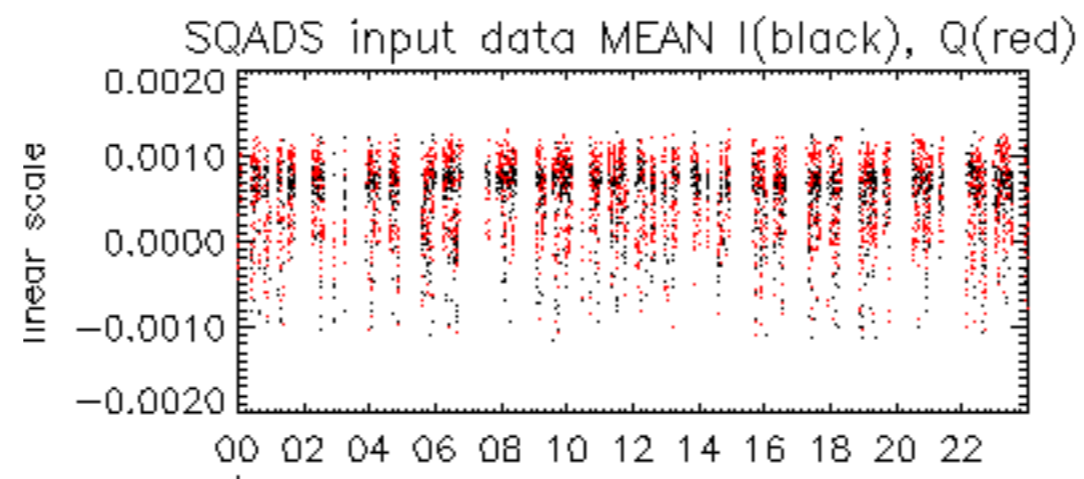


14-Jan

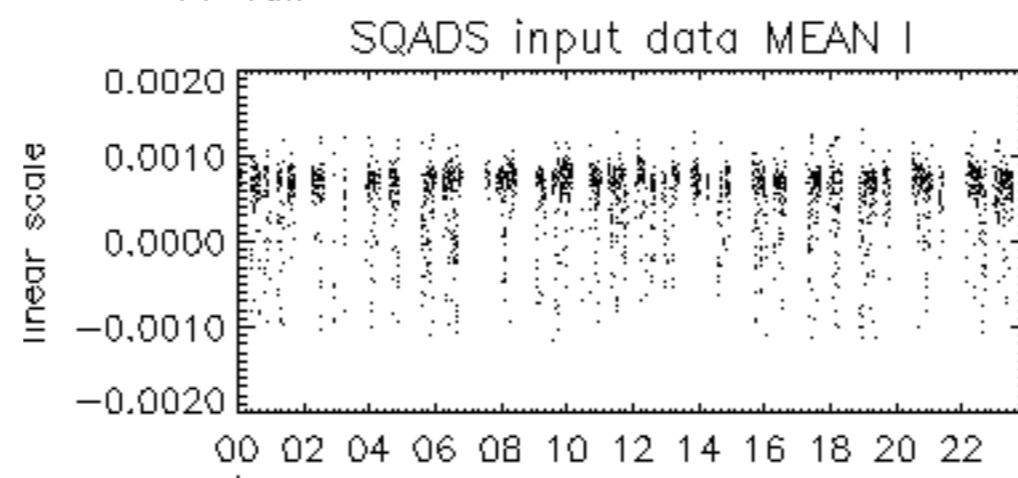


14-Jan

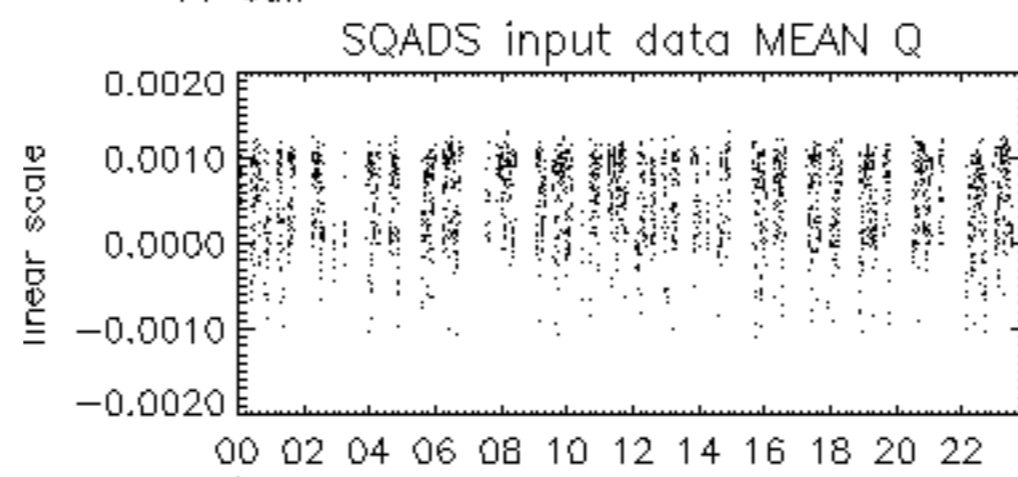


14-Jan

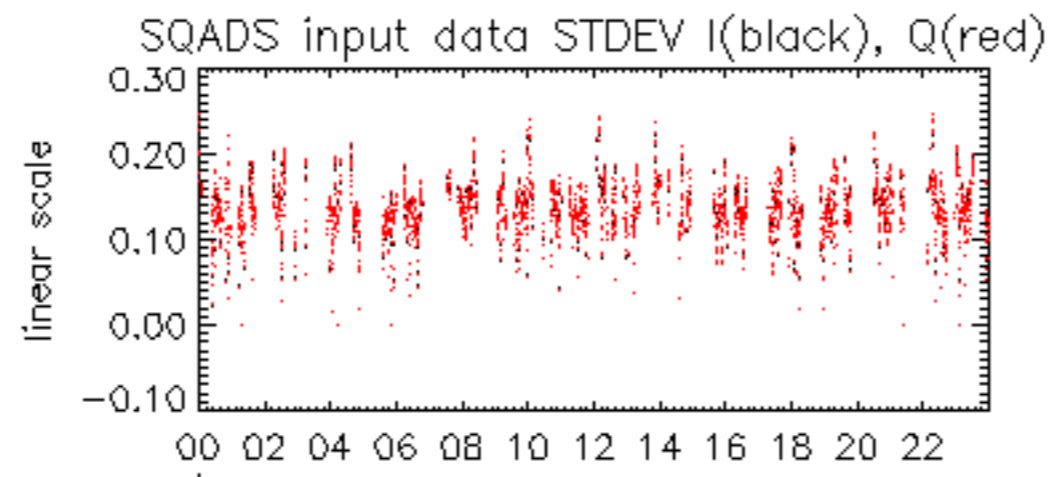

14-Jan

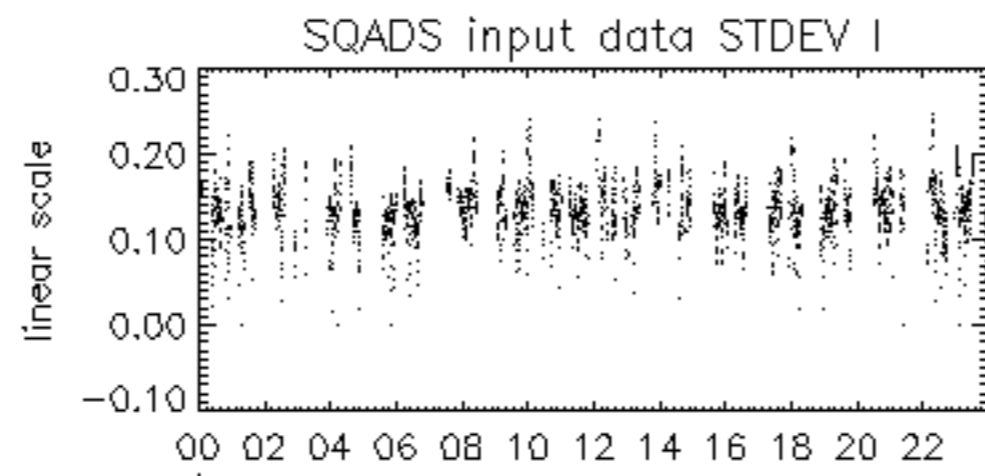

14-Jan

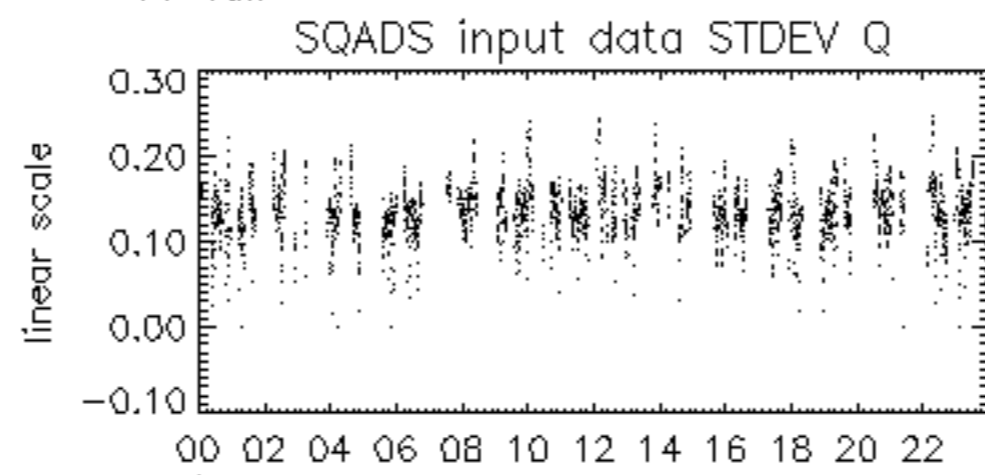

14-Jan

