



ASAR Daily Report



Analysis from 06-APR-2009 00:00:00 to 06-APR-2009 23:00:05. Page generated on 06-APR-2009 23:10:45.
View log file: ASAR_Daily_Report_20090406_2300.log. For any anomalies please contact mtranfaglia@serco.it, Emma.Griffiths@vega.co.uk.

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

SUMMARY

1. DATA SUMMARY
 - 1.1 Summary tables
 - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
 - 2.1 IECF operational ADFs list
 - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
 - 3.1 V/V polarisation
 - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
 - 4.1 Analysis for WVS IS2 V/V
 - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
 - 4.1.2 All Rows Analysis for WVS IS2 V/V
 - 4.2 Analysis for GM1 SS3 H/H
 - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
 - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
 - 5.1 Analysis for WVS IS2 V/V
 - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
 - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
 - 5.2 Analysis for GM1 SS1 H/H
 - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
 - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
 - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
 - 6.1 Analysis for WSM SS1 H/H
 - 6.1.1 ScaleFactor
 - 6.2 Analysis for WSM SS1 V/V
 - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
 - 7.1 Analysis for WVS
 - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
 - 8.1 Number of Missing Lines
 - 8.2 Number of Gaps

1 - DATA SUMMARY

1.1 - Summary tables

[[BACK TO MENU](#)]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	1	PDE	WS	H/H	26	PDE	IS6	H/H	1	PDE	IS1	V/V	1	PDE	WS	H/H	37	PDK	2009-04-06 09:07:09	H	320
PDE	IS2	V/V	19	PDK	WS	H/H	39					PDE	IS2	H/H	1	PDE	WS	V/V	9	PDK	2009-04-06 18:05:03	V	320
PDK	IS2	V/V	26									PDE	IS2	V/V	15								
												PDE	IS6	V/V	1								
												PDK	IS2	***	1								
												PDK	IS2	H/H	2								
												PDK	IS2	V/V	2								

1.2 - Lists of products used

[[BACK TO MENU](#)]

[[TXT](#)] [[XLS](#)] [List_WVS_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_GM1_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_APM_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_IMM_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_WSM_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_MS_products_used](#)

2 - AUXILIARY FILES ANALYSIS

2.1 - IECF operational ADFs list

[[BACK TO MENU](#)]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20081215_141339_20070204_165113_20091231_000000
ASA_INS_AXVIEC20081215_140905_20070307_060000_20091231_000000
ASA_XCH_AXVIEC20081215_143642_20020301_000000_20091231_000000
ASA_XCA_AXVIEC20090311_104501_20080801_000000_20091231_235959

2.2 - Products with wrong ADFs




[[BACK TO MENU](#)]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0

[[TXT](#)] [[XLS](#)] [Check_ADFs_WVS](#)
 [[TXT](#)] [[XLS](#)] [Check_ADFs_GM1](#)
 [[TXT](#)] [[XLS](#)] [Check_ADFs_APM](#)
 [[TXT](#)] [[XLS](#)] [Check_ADFs_IMM](#)
 [[TXT](#)] [[XLS](#)] [Check_ADFs_WSM](#)

3 - MODULE STEPPING PRODUCTS ANALYSIS






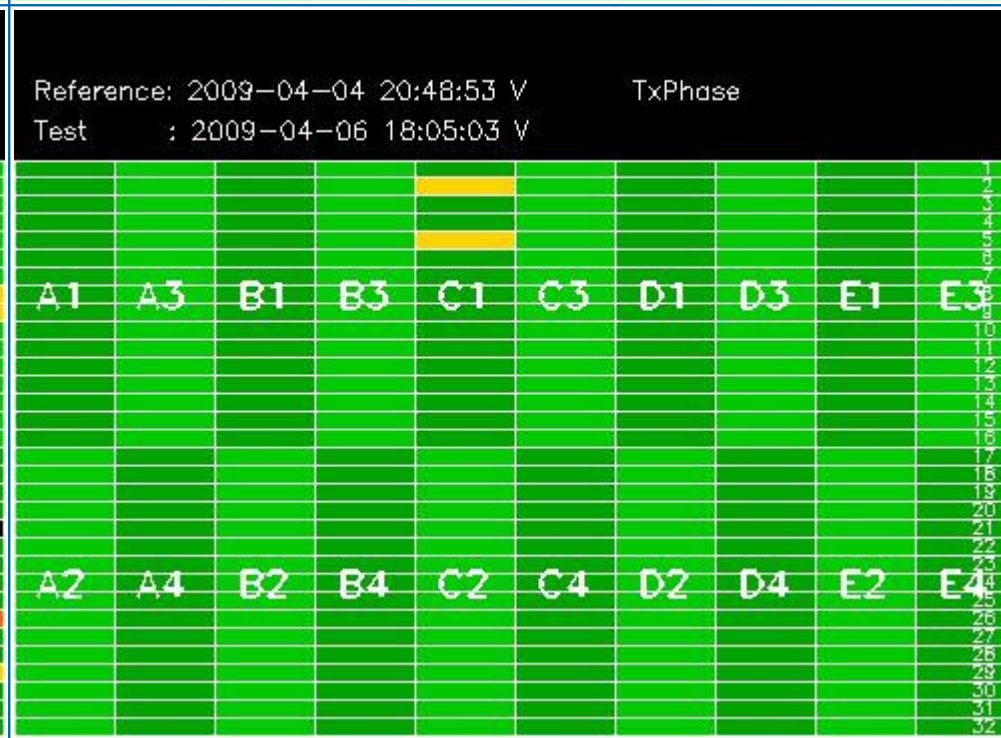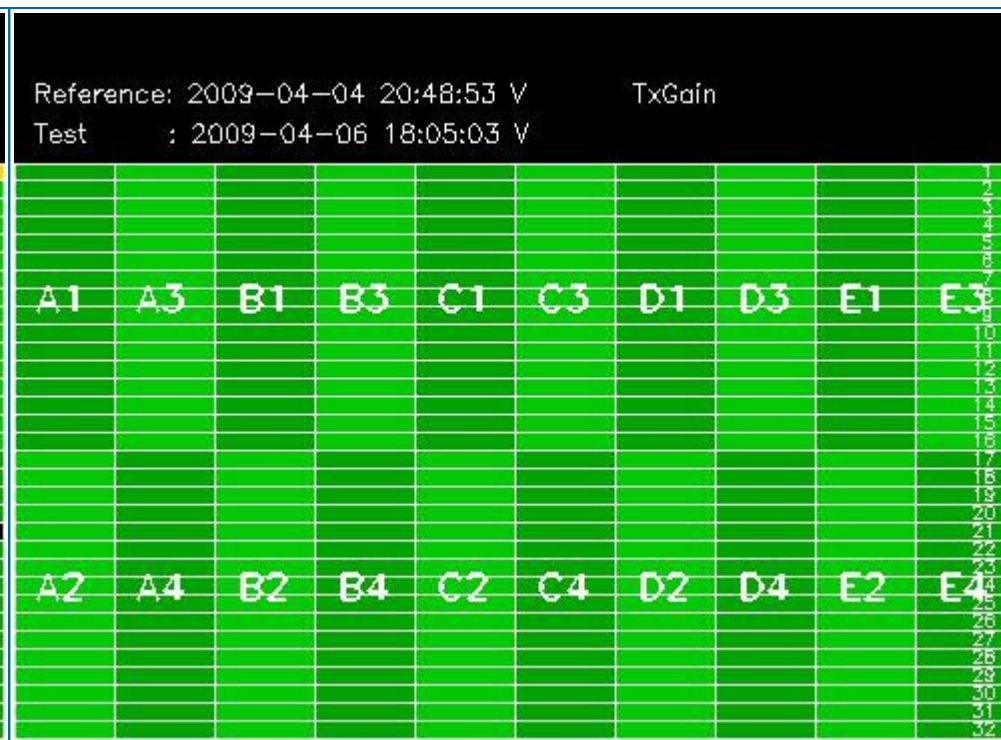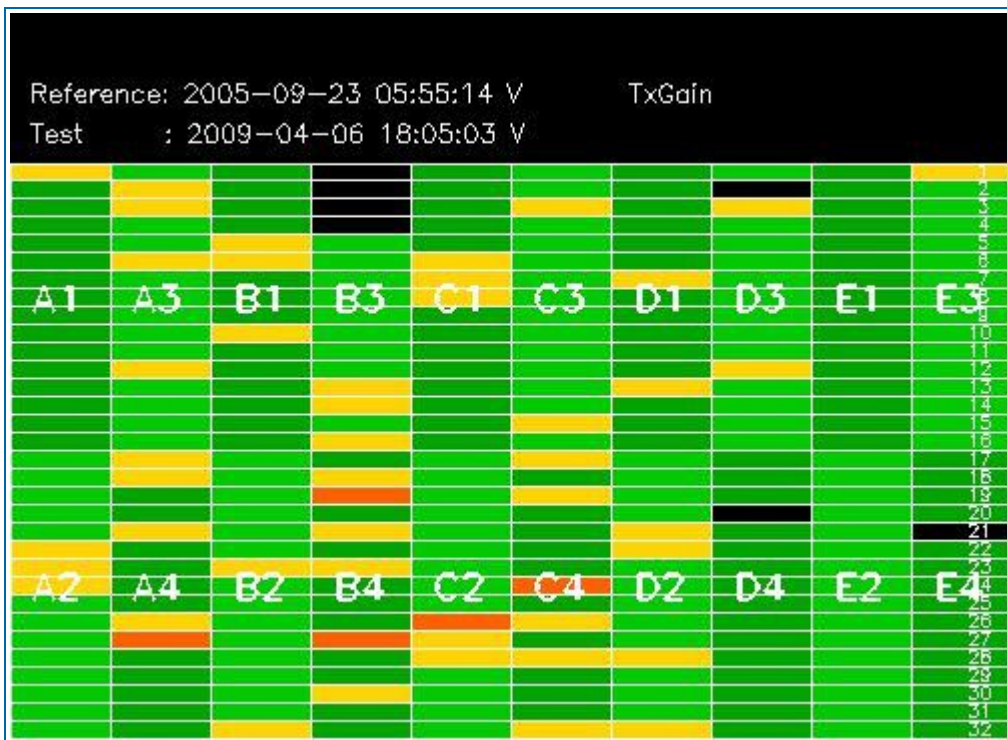

3.2 - H/H polarisation

[[BACK TO MENU](#)]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
After antenna maintenance (2005-09-22/23)	Previous product in the same polarisation

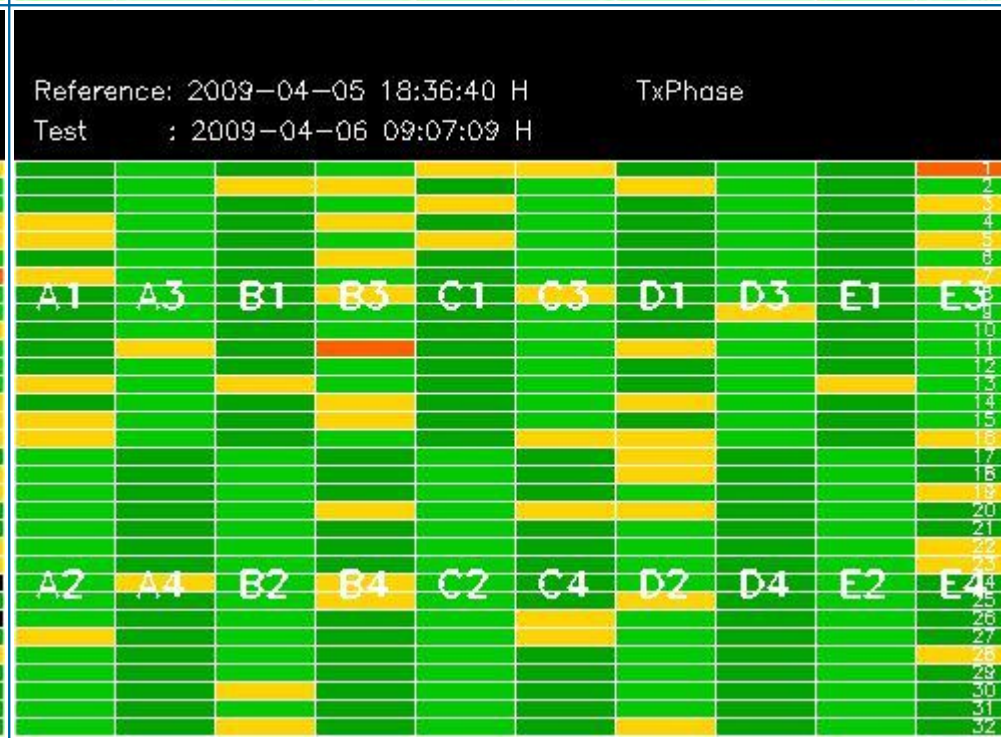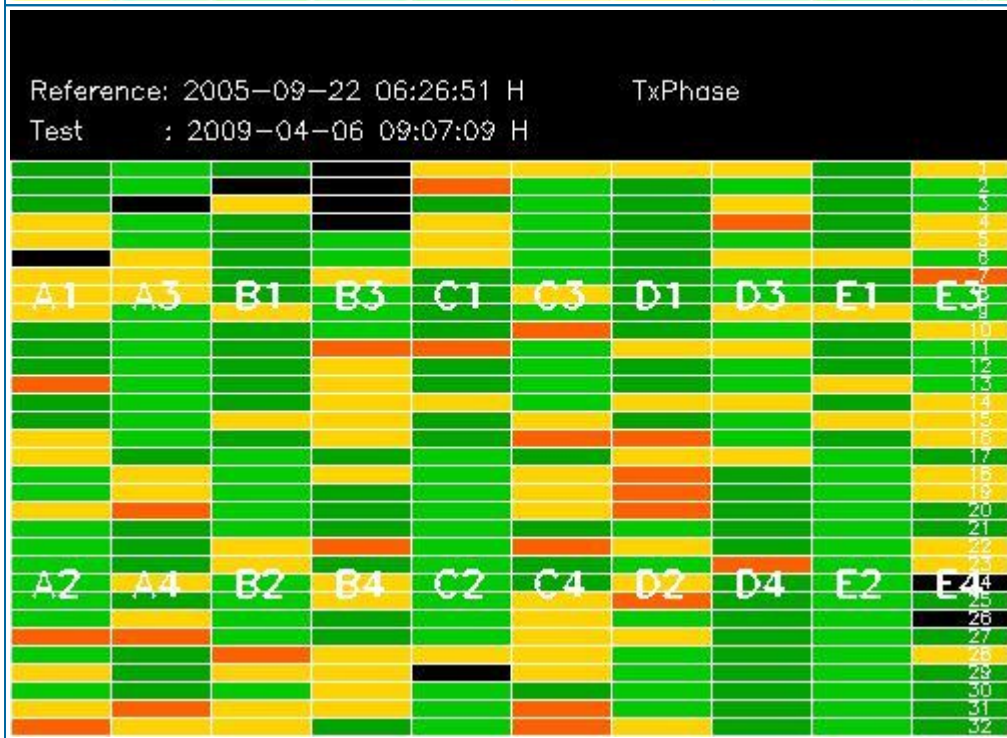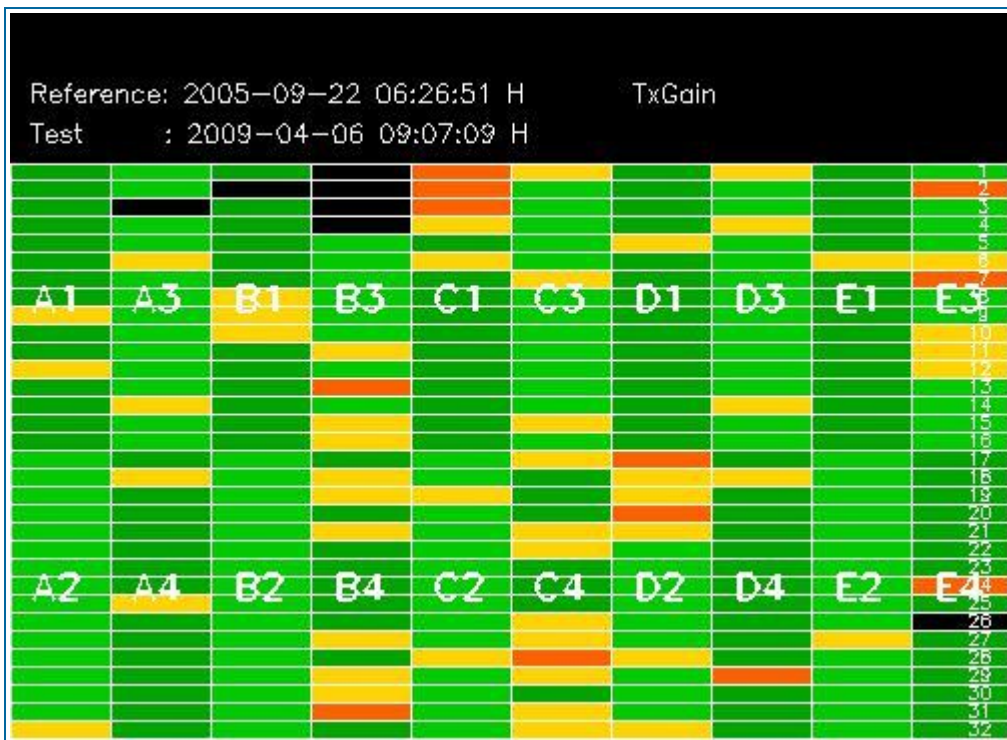

4 - CALIBRATION PULSES ANALYSIS

4.1 - Analysis for WVS IS2 V/V


4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for WVS IS2 V/V

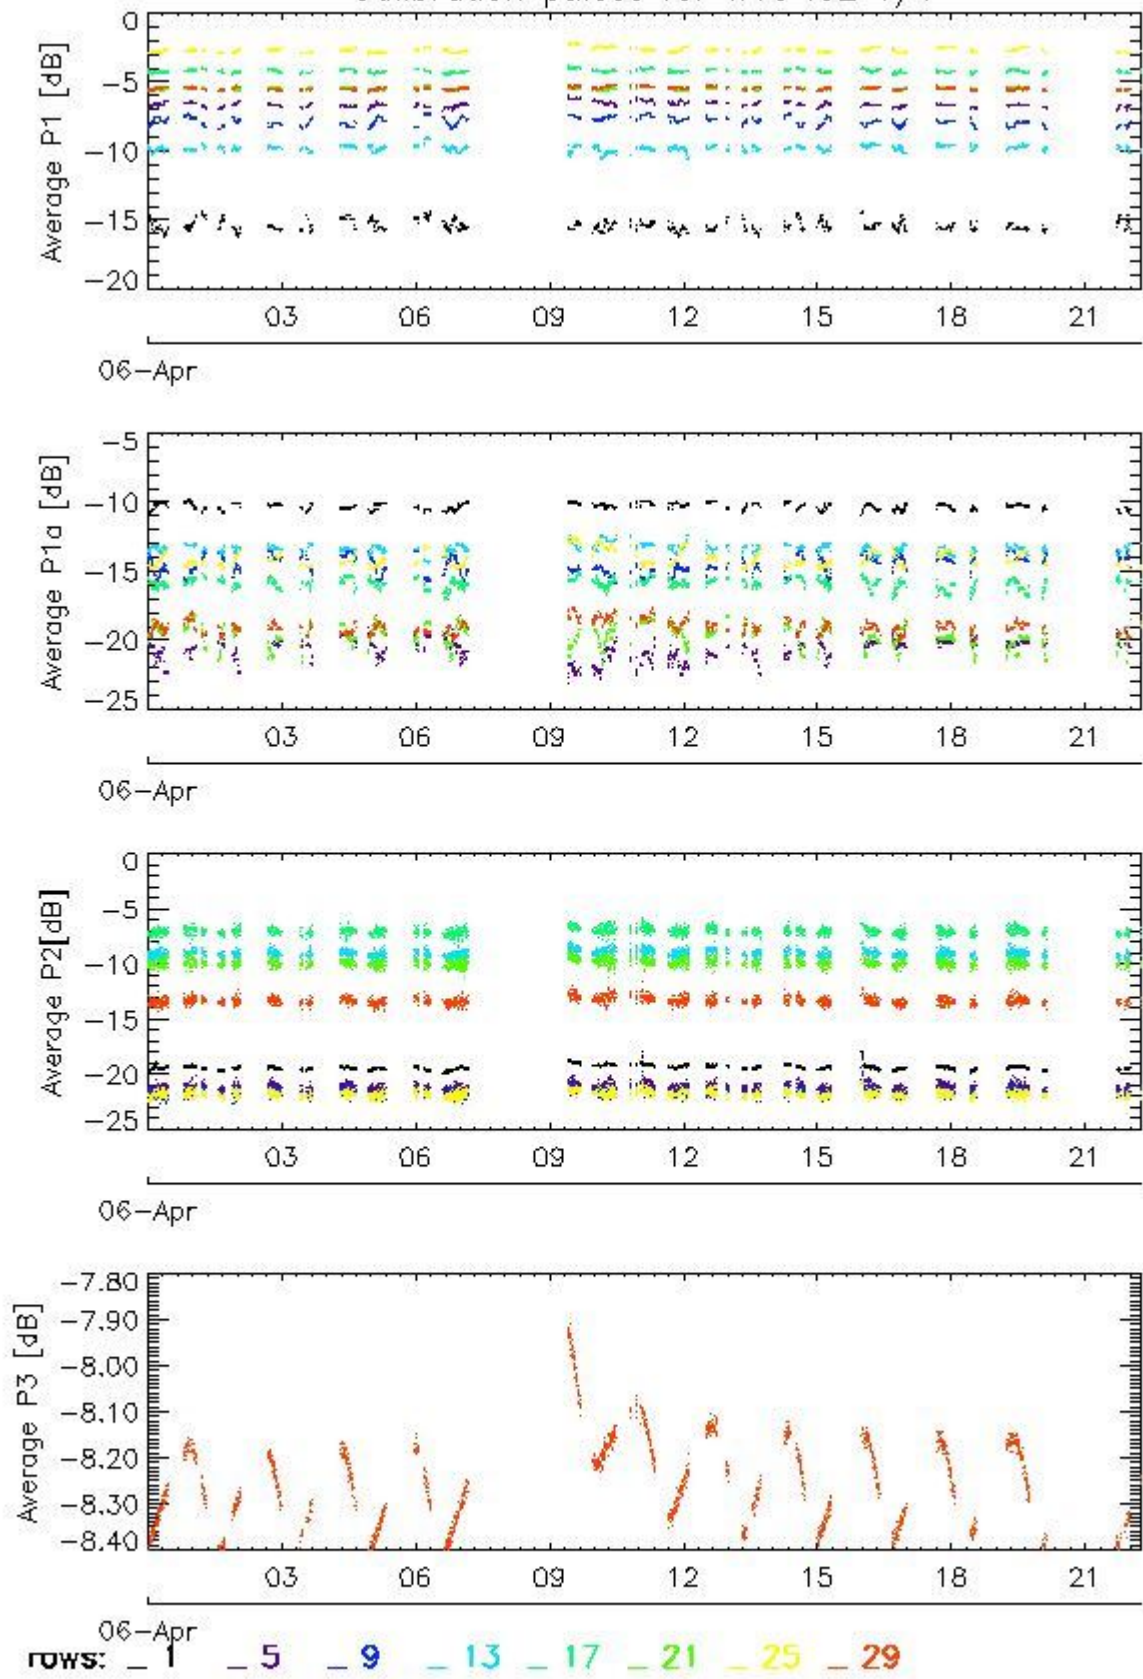


Transmit power (P1 - P1a) for WVS IS2 V/V

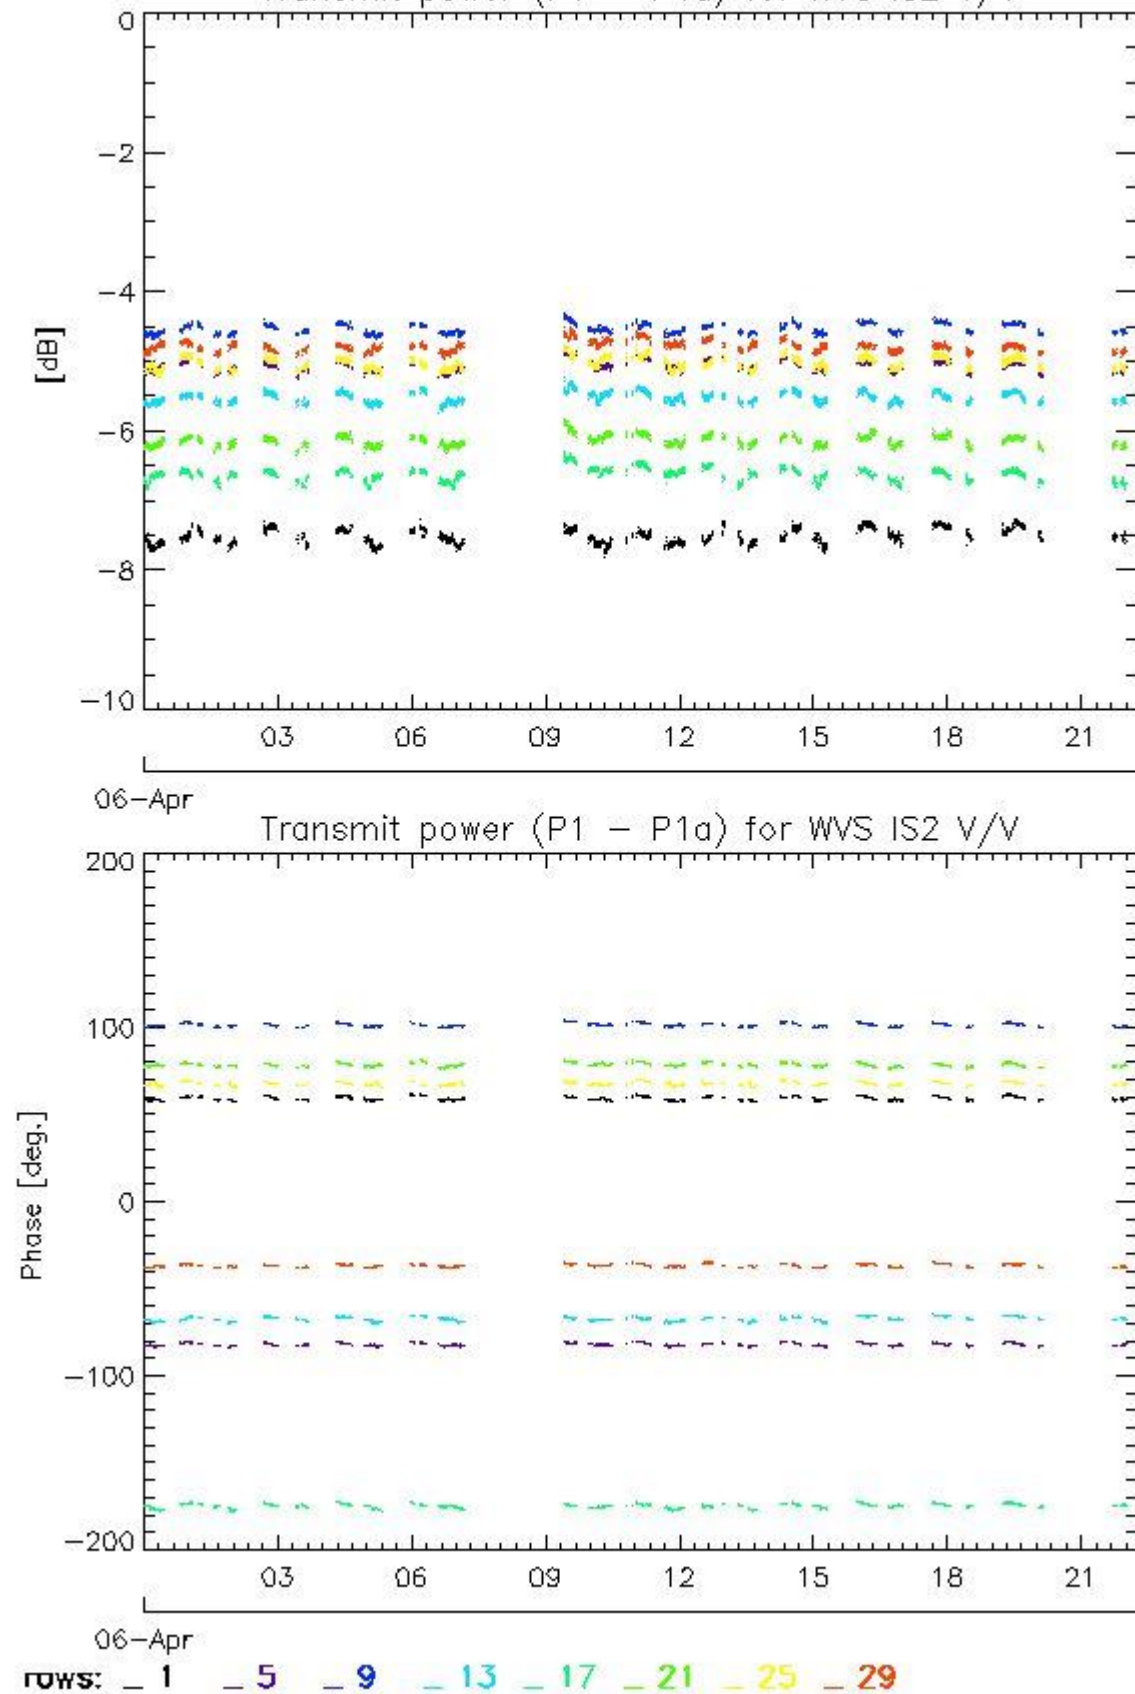

4.1.2 - All Rows Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



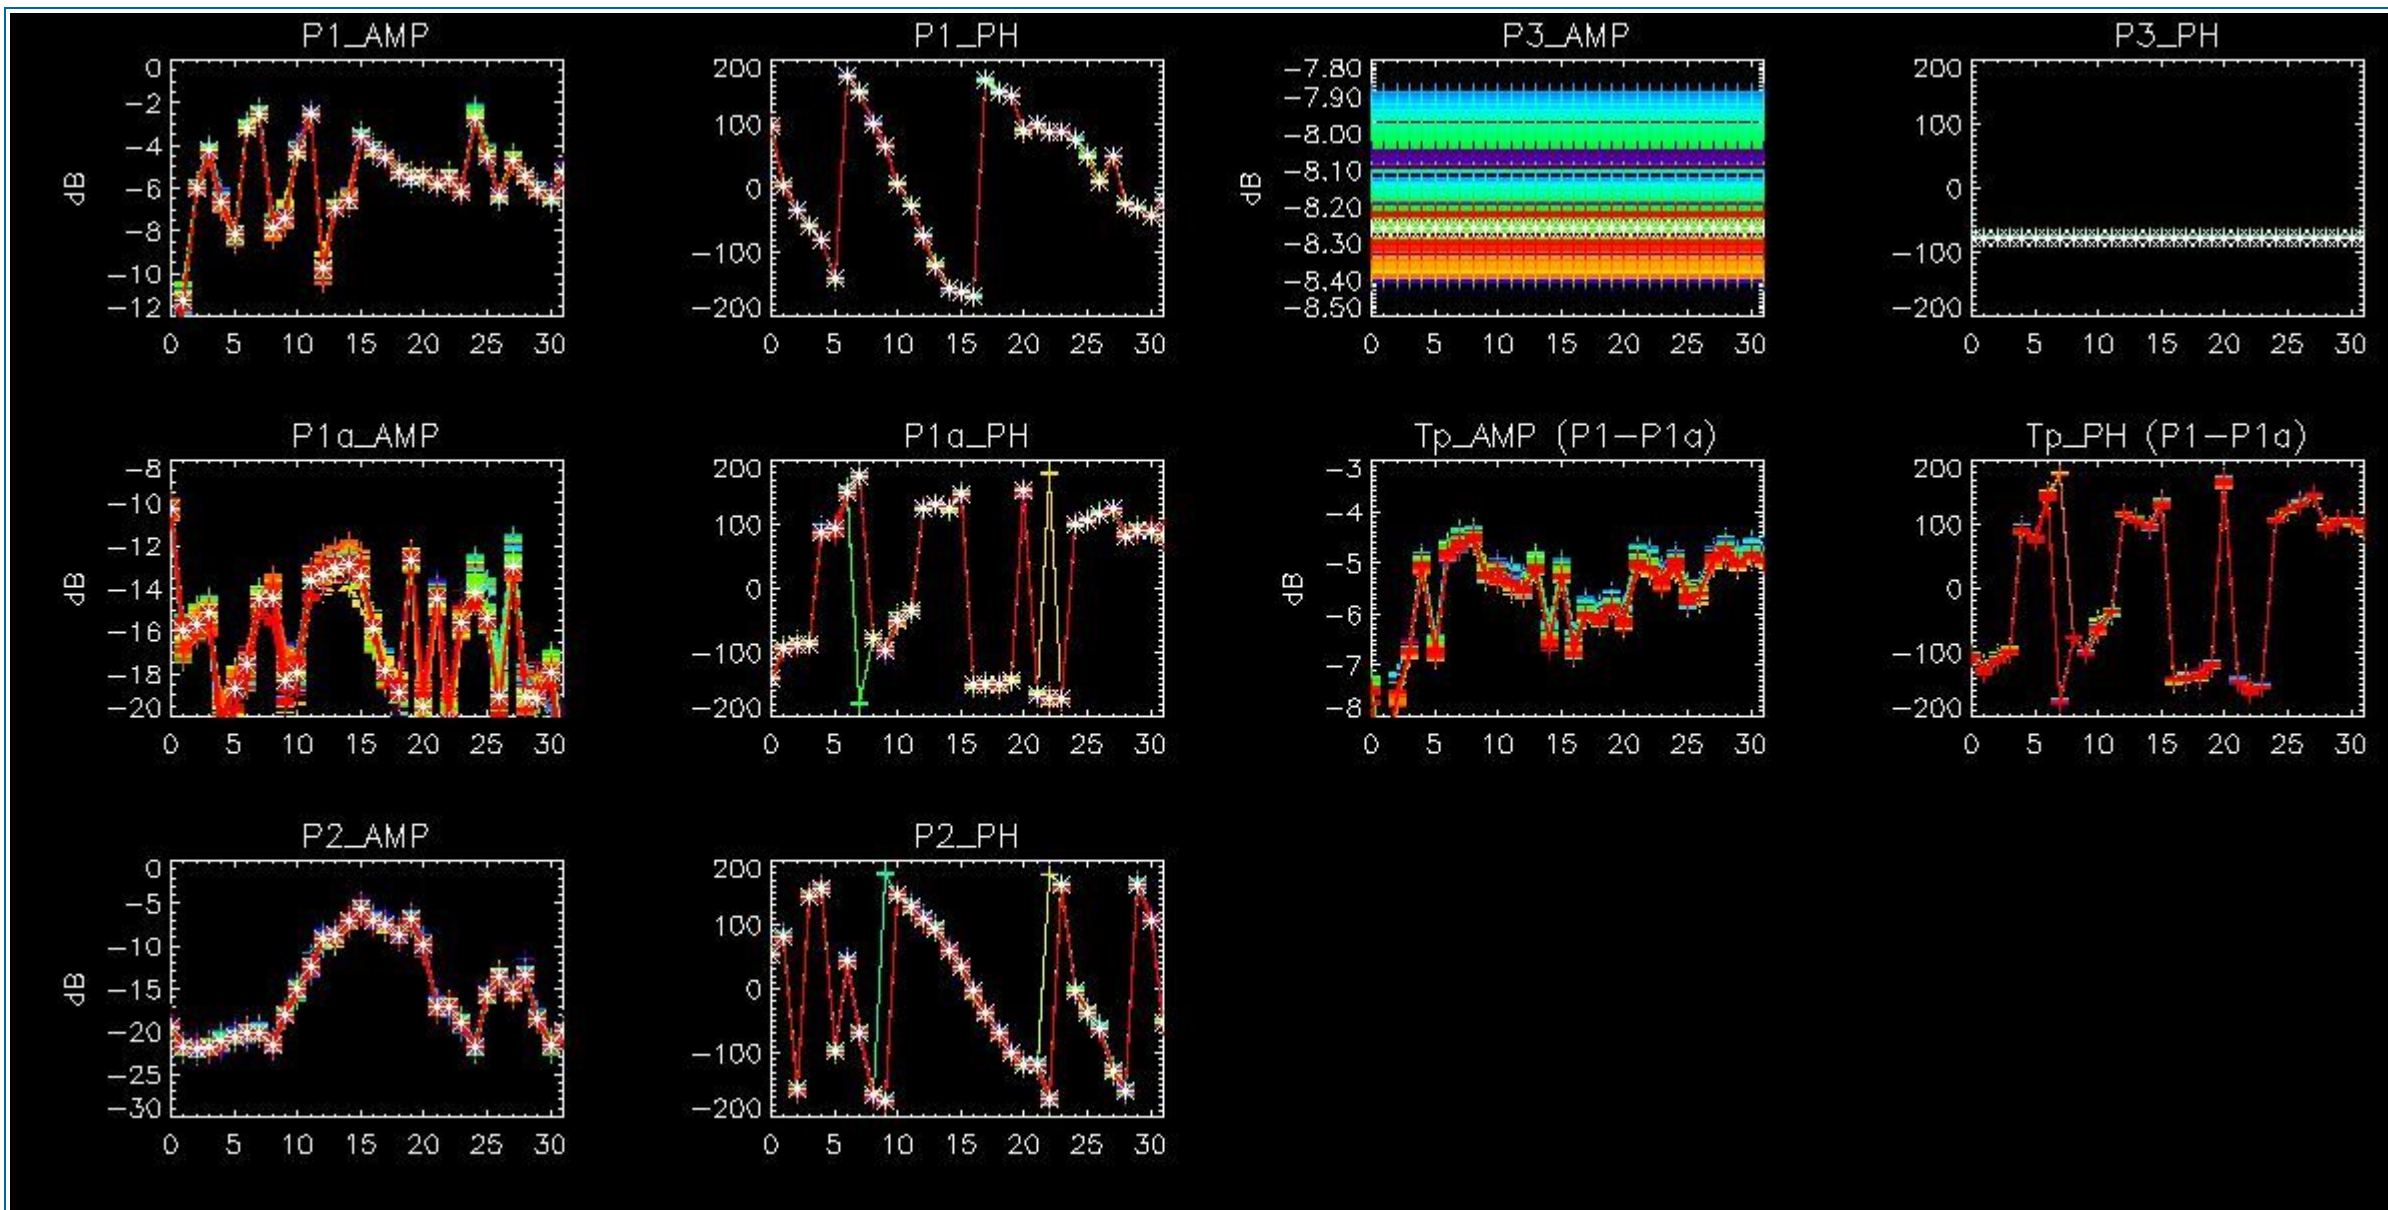

4.2 - Analysis for GM1 SS3 H/H


4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]


Calibration pulses for GM1 SS3 H/H

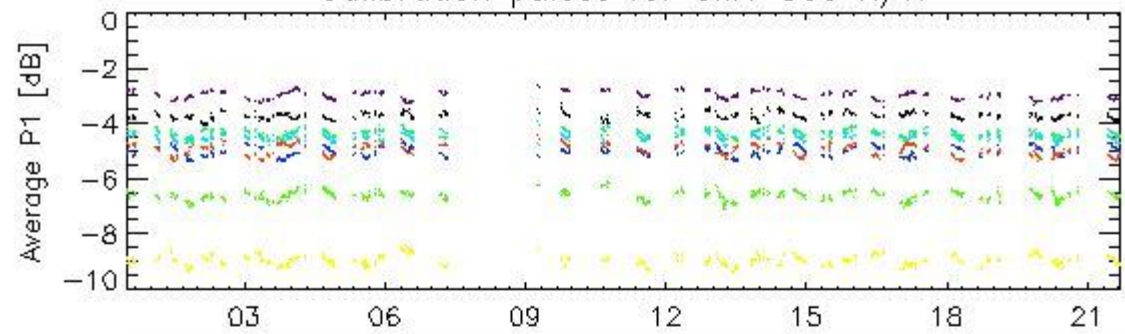


06-Apr

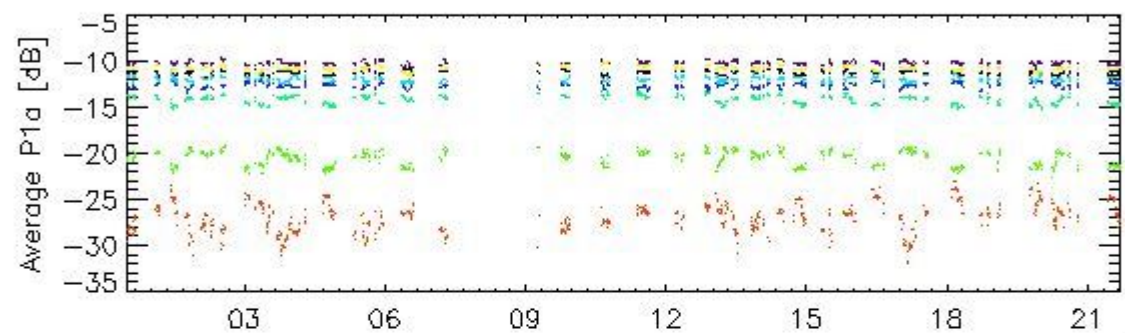

06-Apr

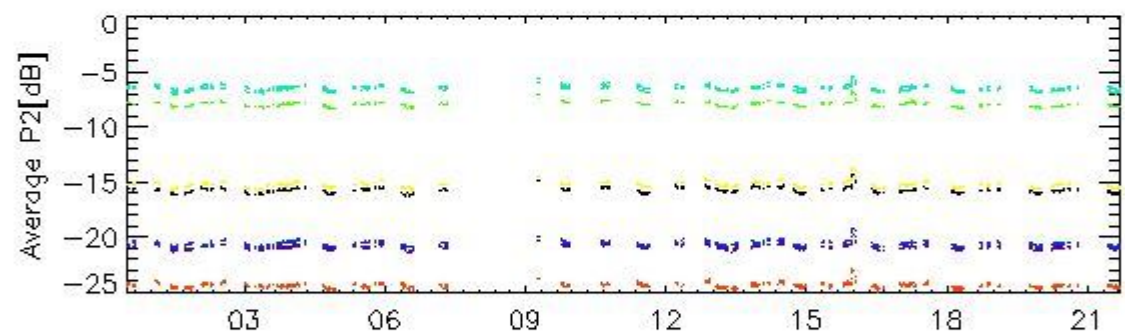


06-Apr

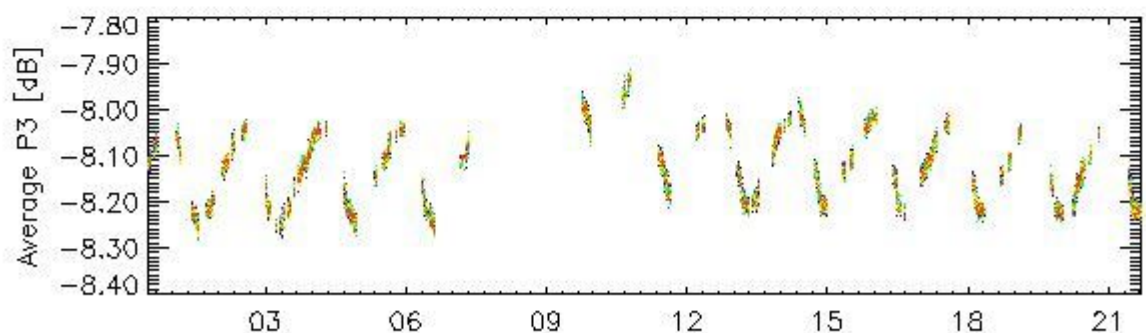

06-Apr


rows: _ 1 _ 5 _ 9 _ 13 _ 17 _ 21 _ 25 _ 29

Transmit power (P1 - P1a) for GM1 SS3 H/H

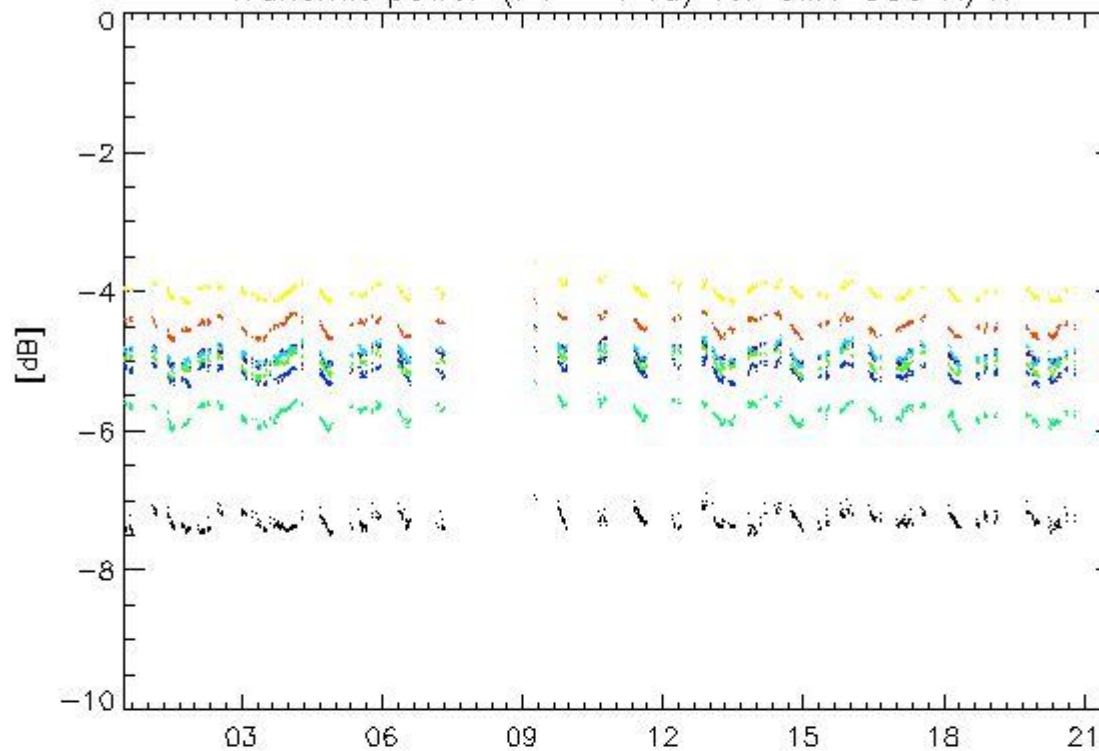

06-Apr

Transmit power (P1 - P1a) for GM1 SS3 H/H

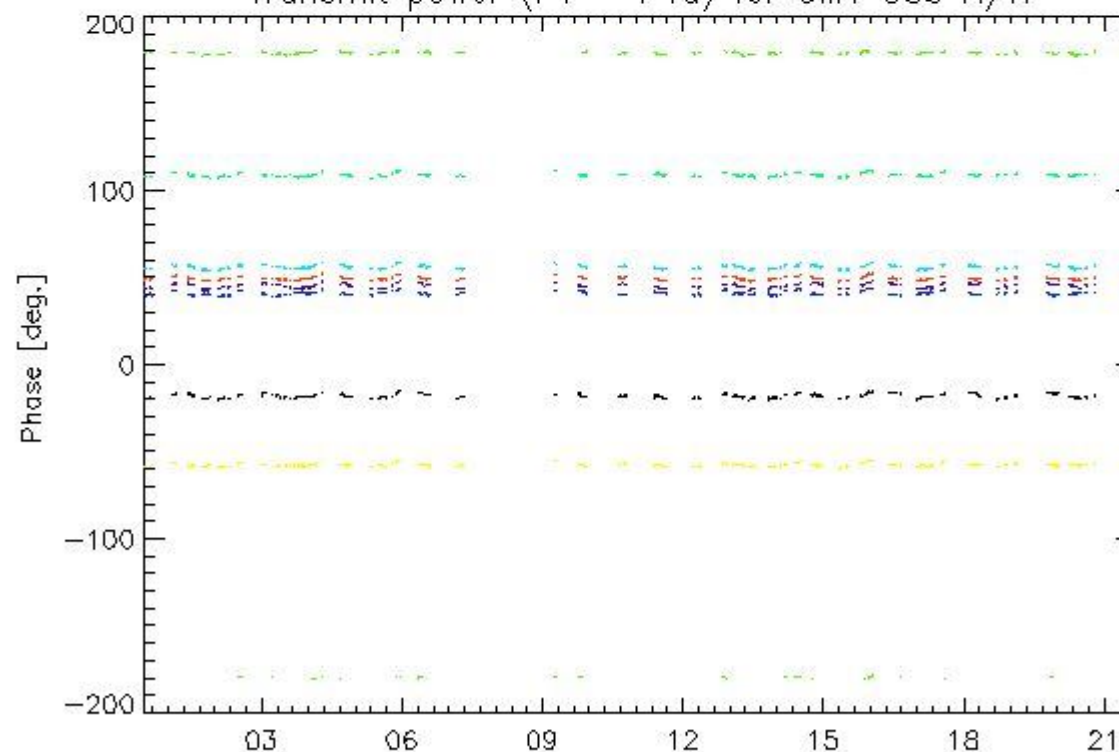



06-Apr

rows: _ 1 _ 5 _ 9 _ 13 _ 17 _ 21 _ 25 _ 29

4.2.2 - All Rows Analysis for GM1 SS3 H/H

[[BACK TO MENU](#)]



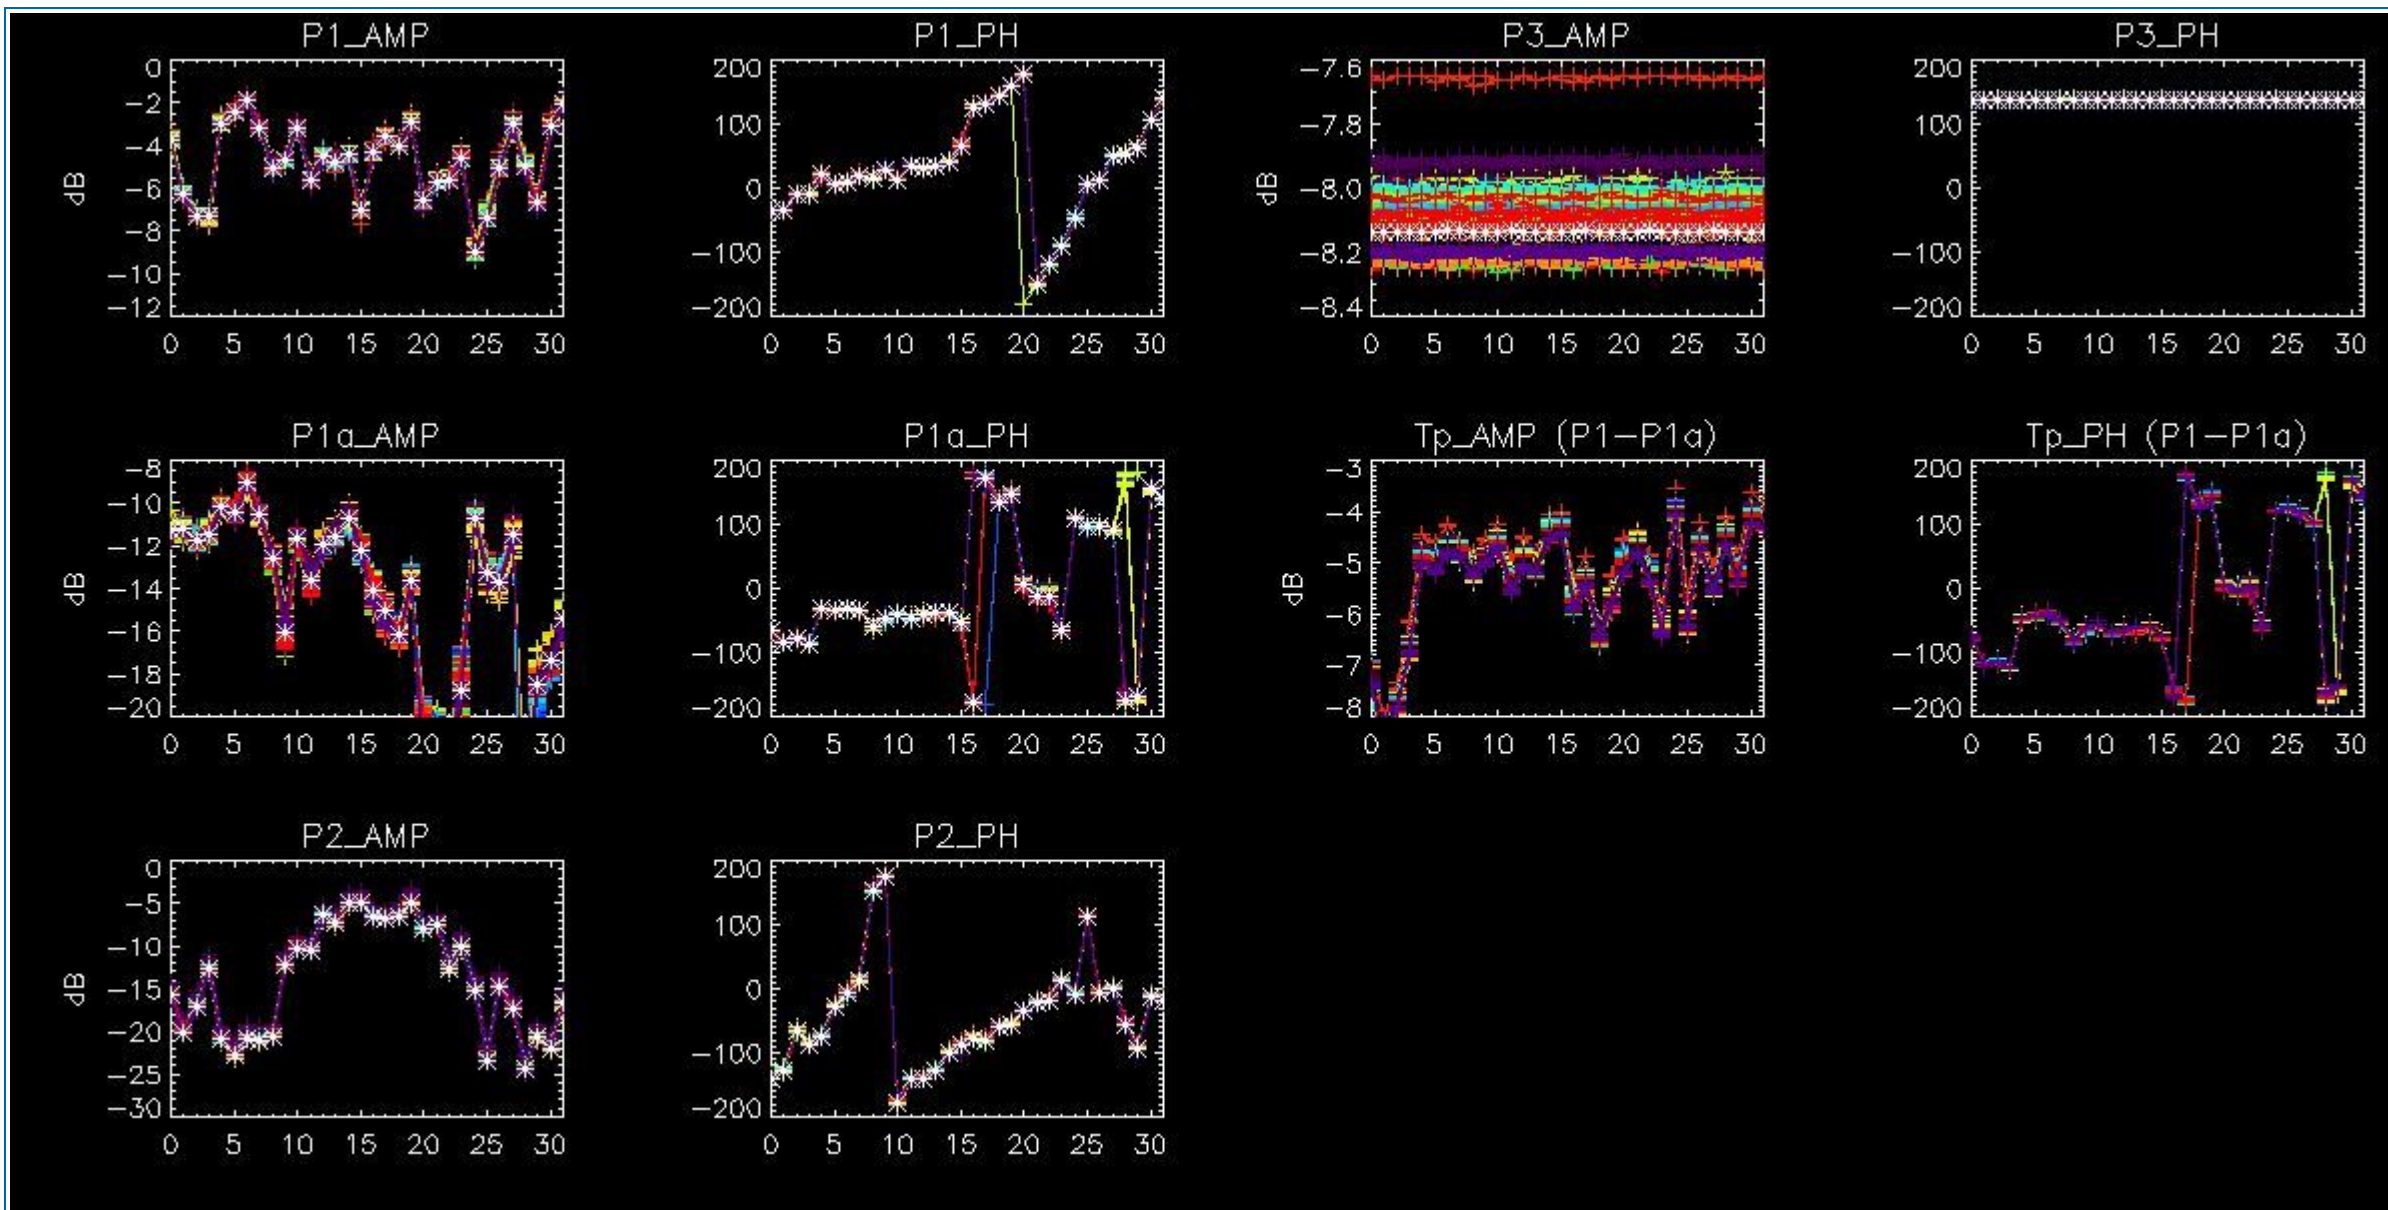


5 - DOPPLER ANALYSIS

5.1 - Analysis for WVS IS2 V/V

5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]




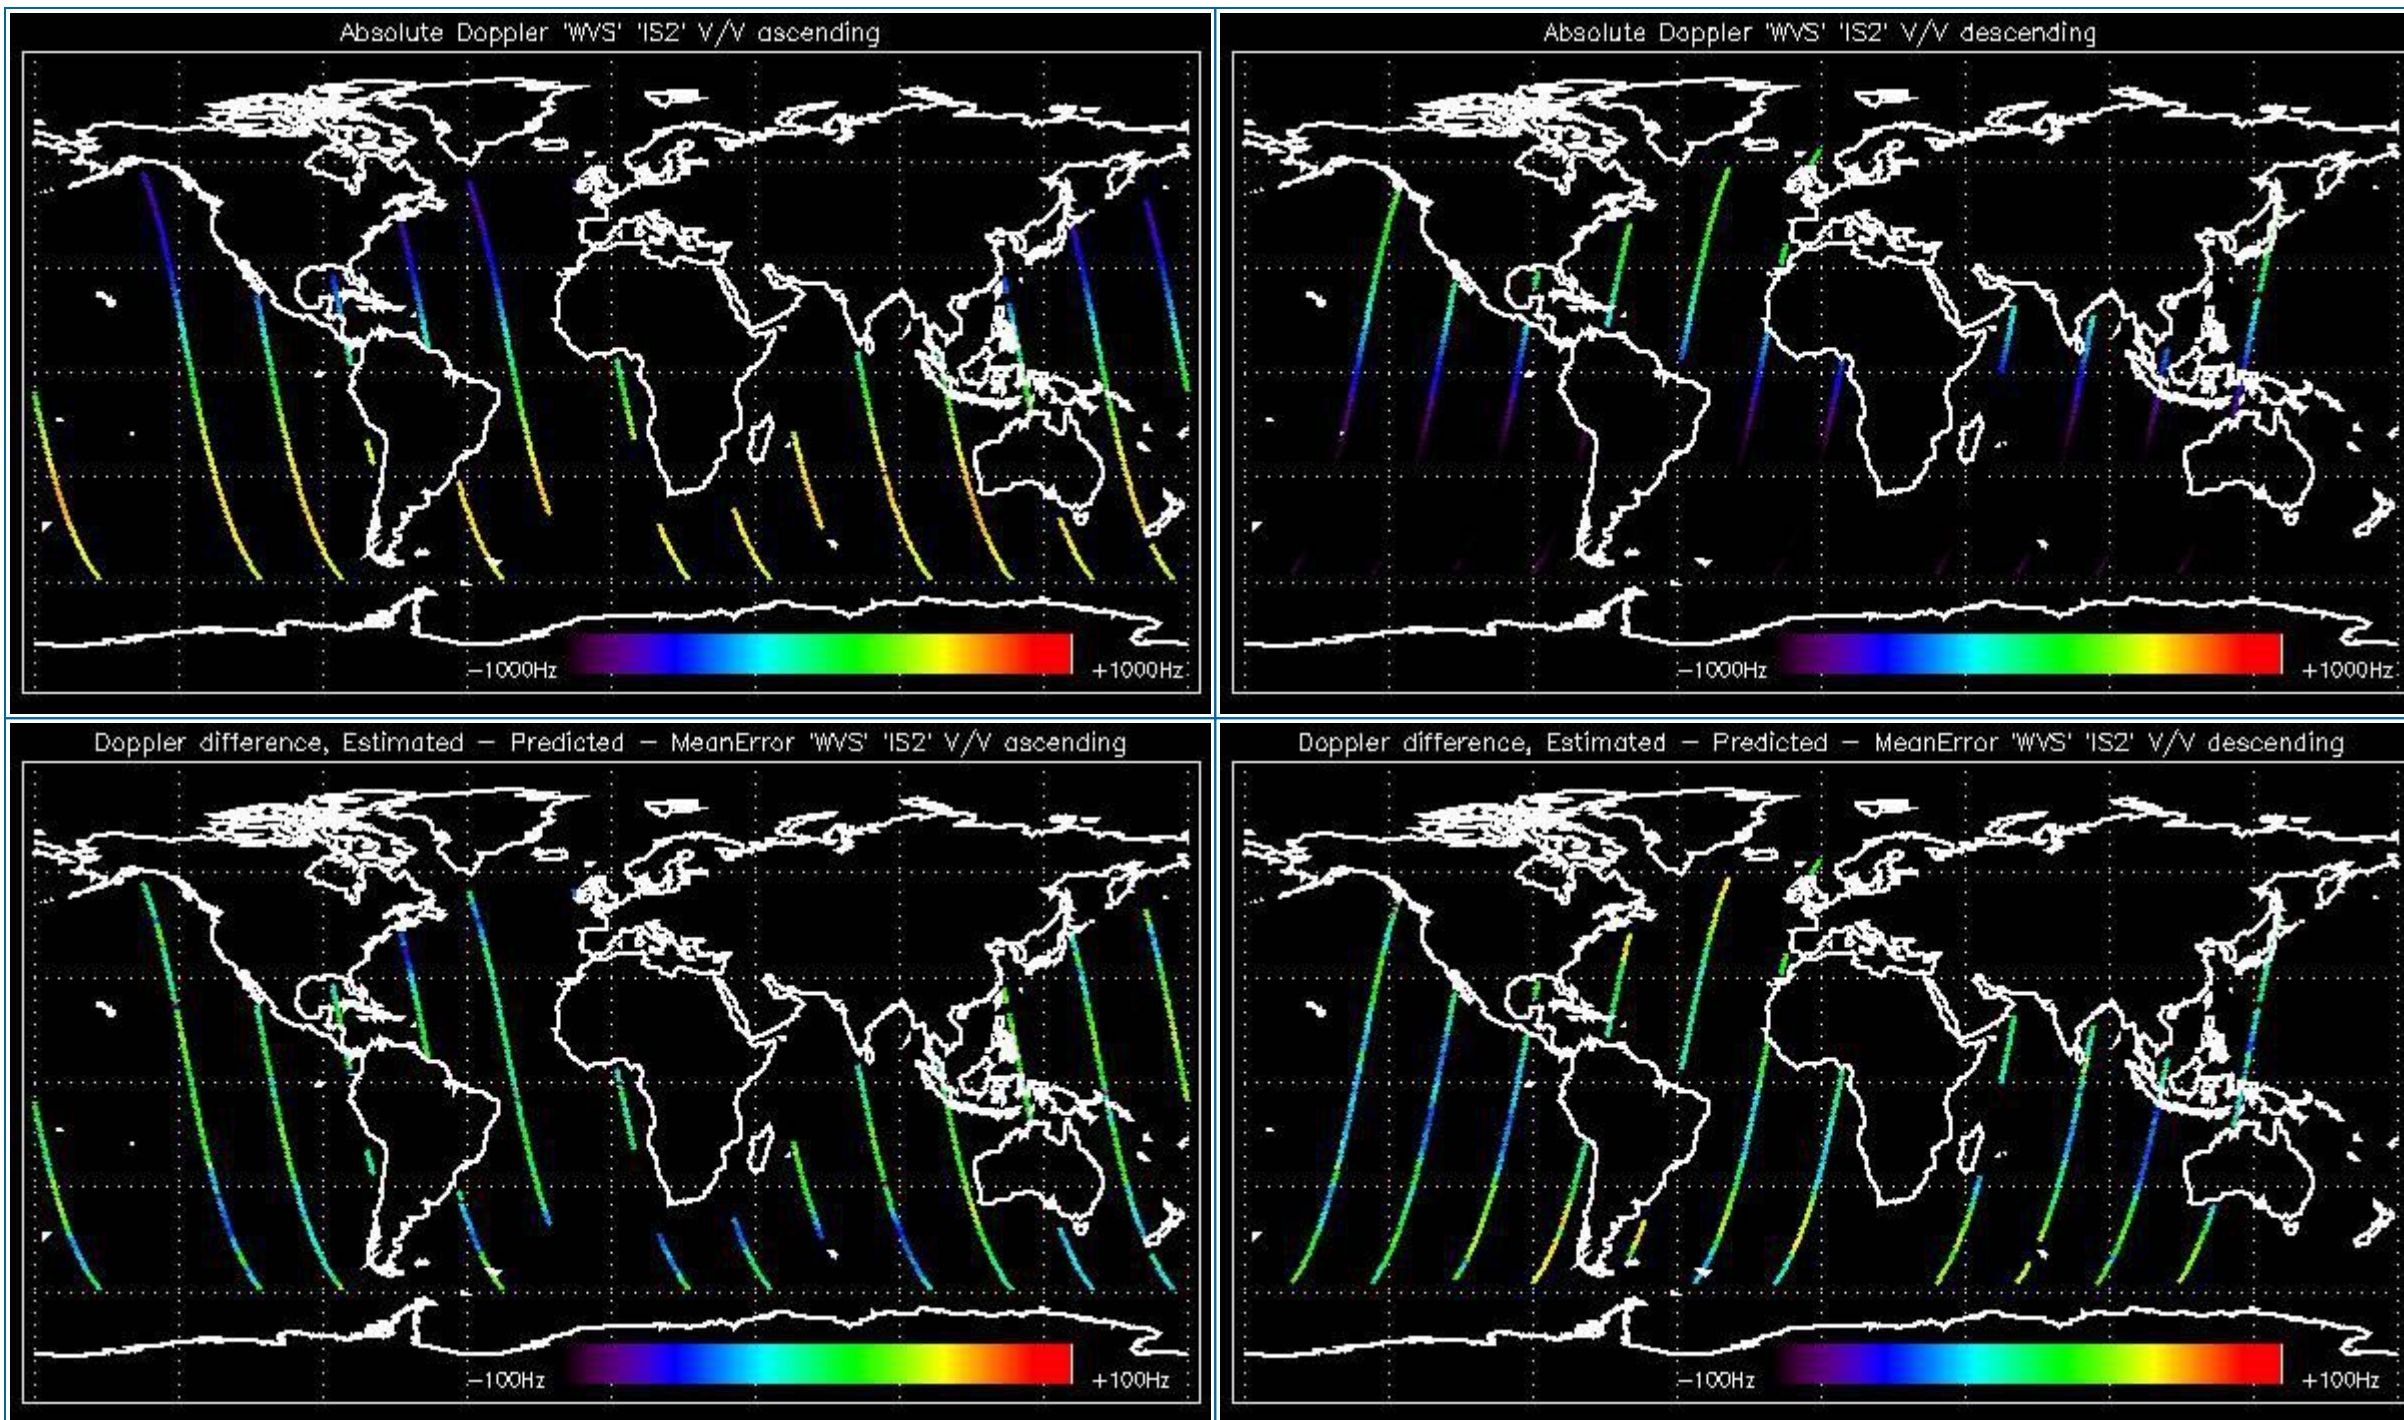

5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



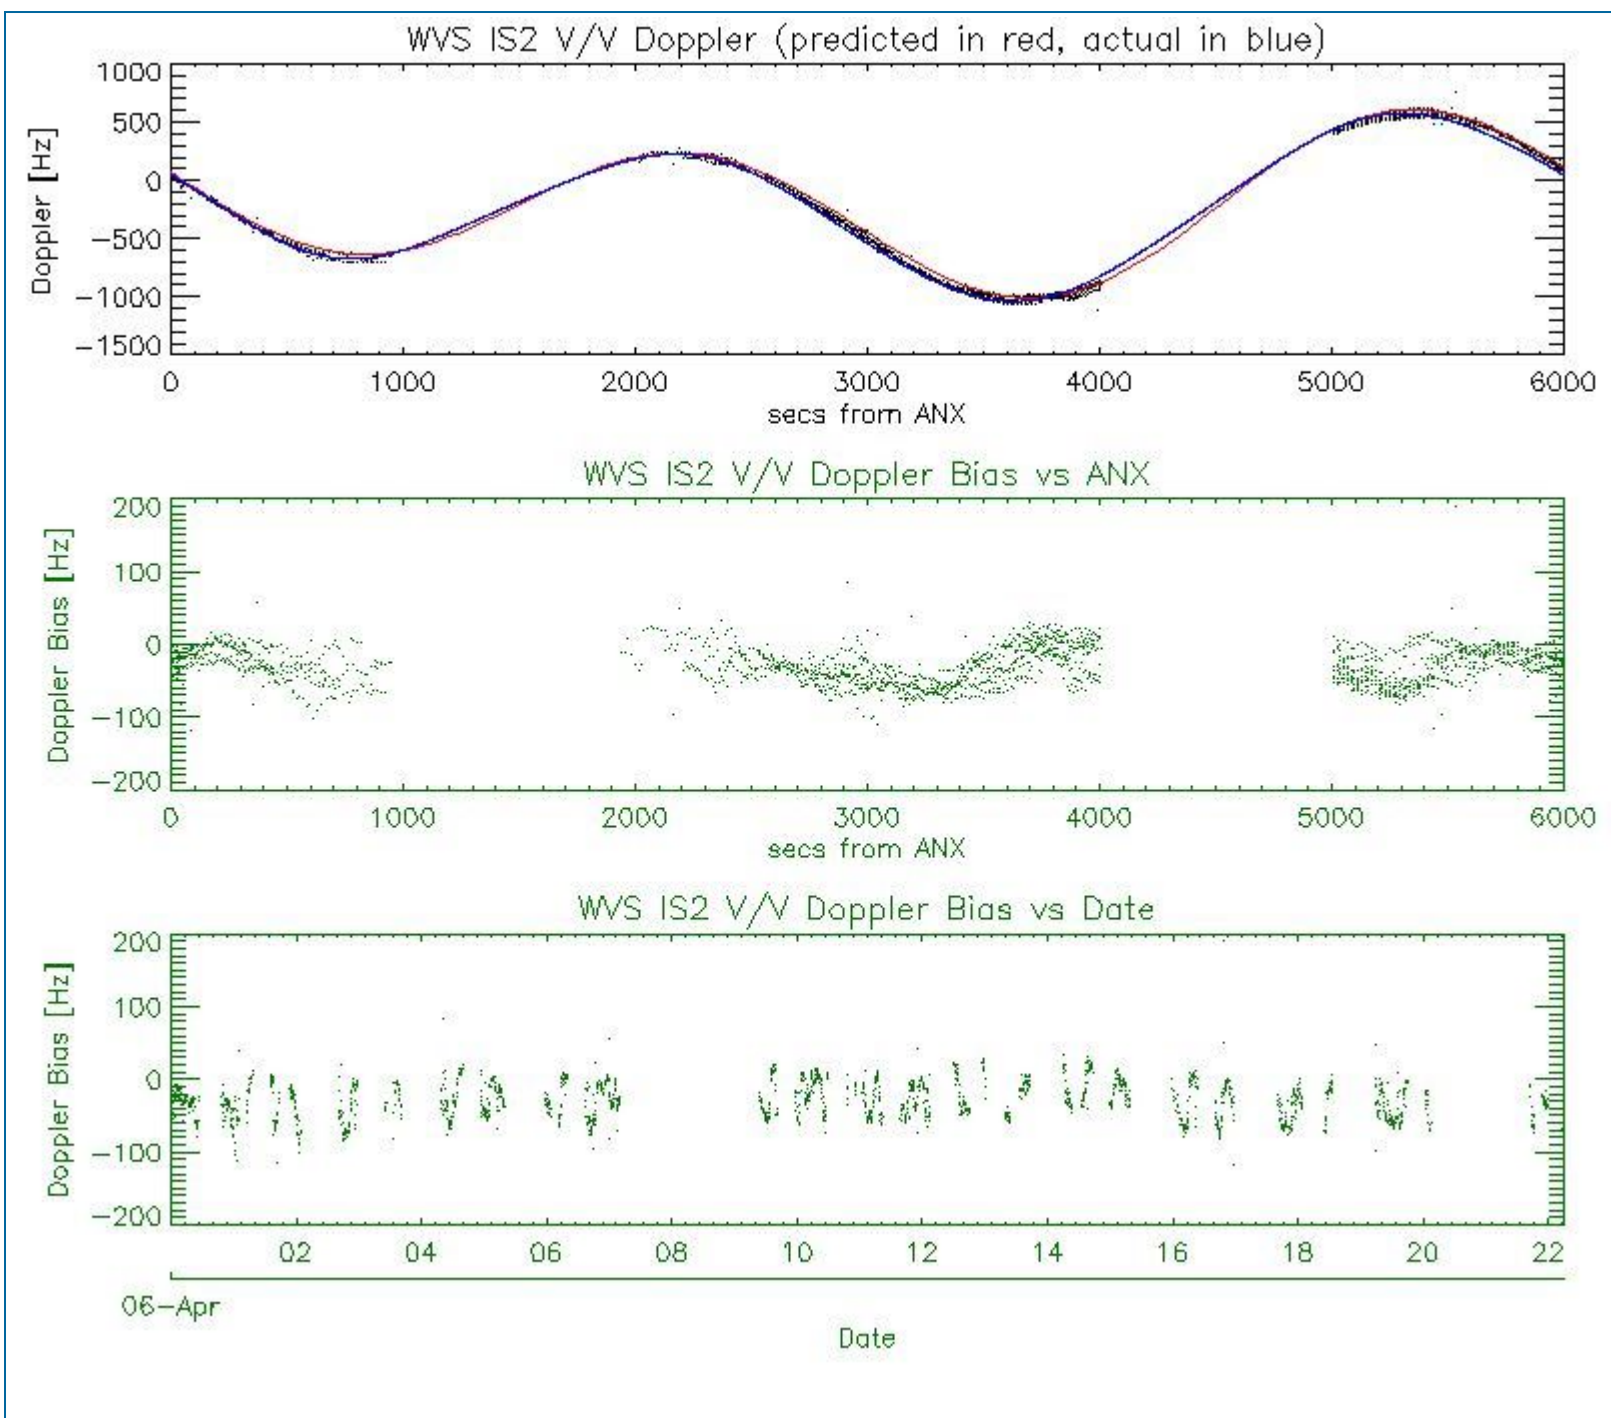


5.2 - Analysis for GM1 SS1 H/H

5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




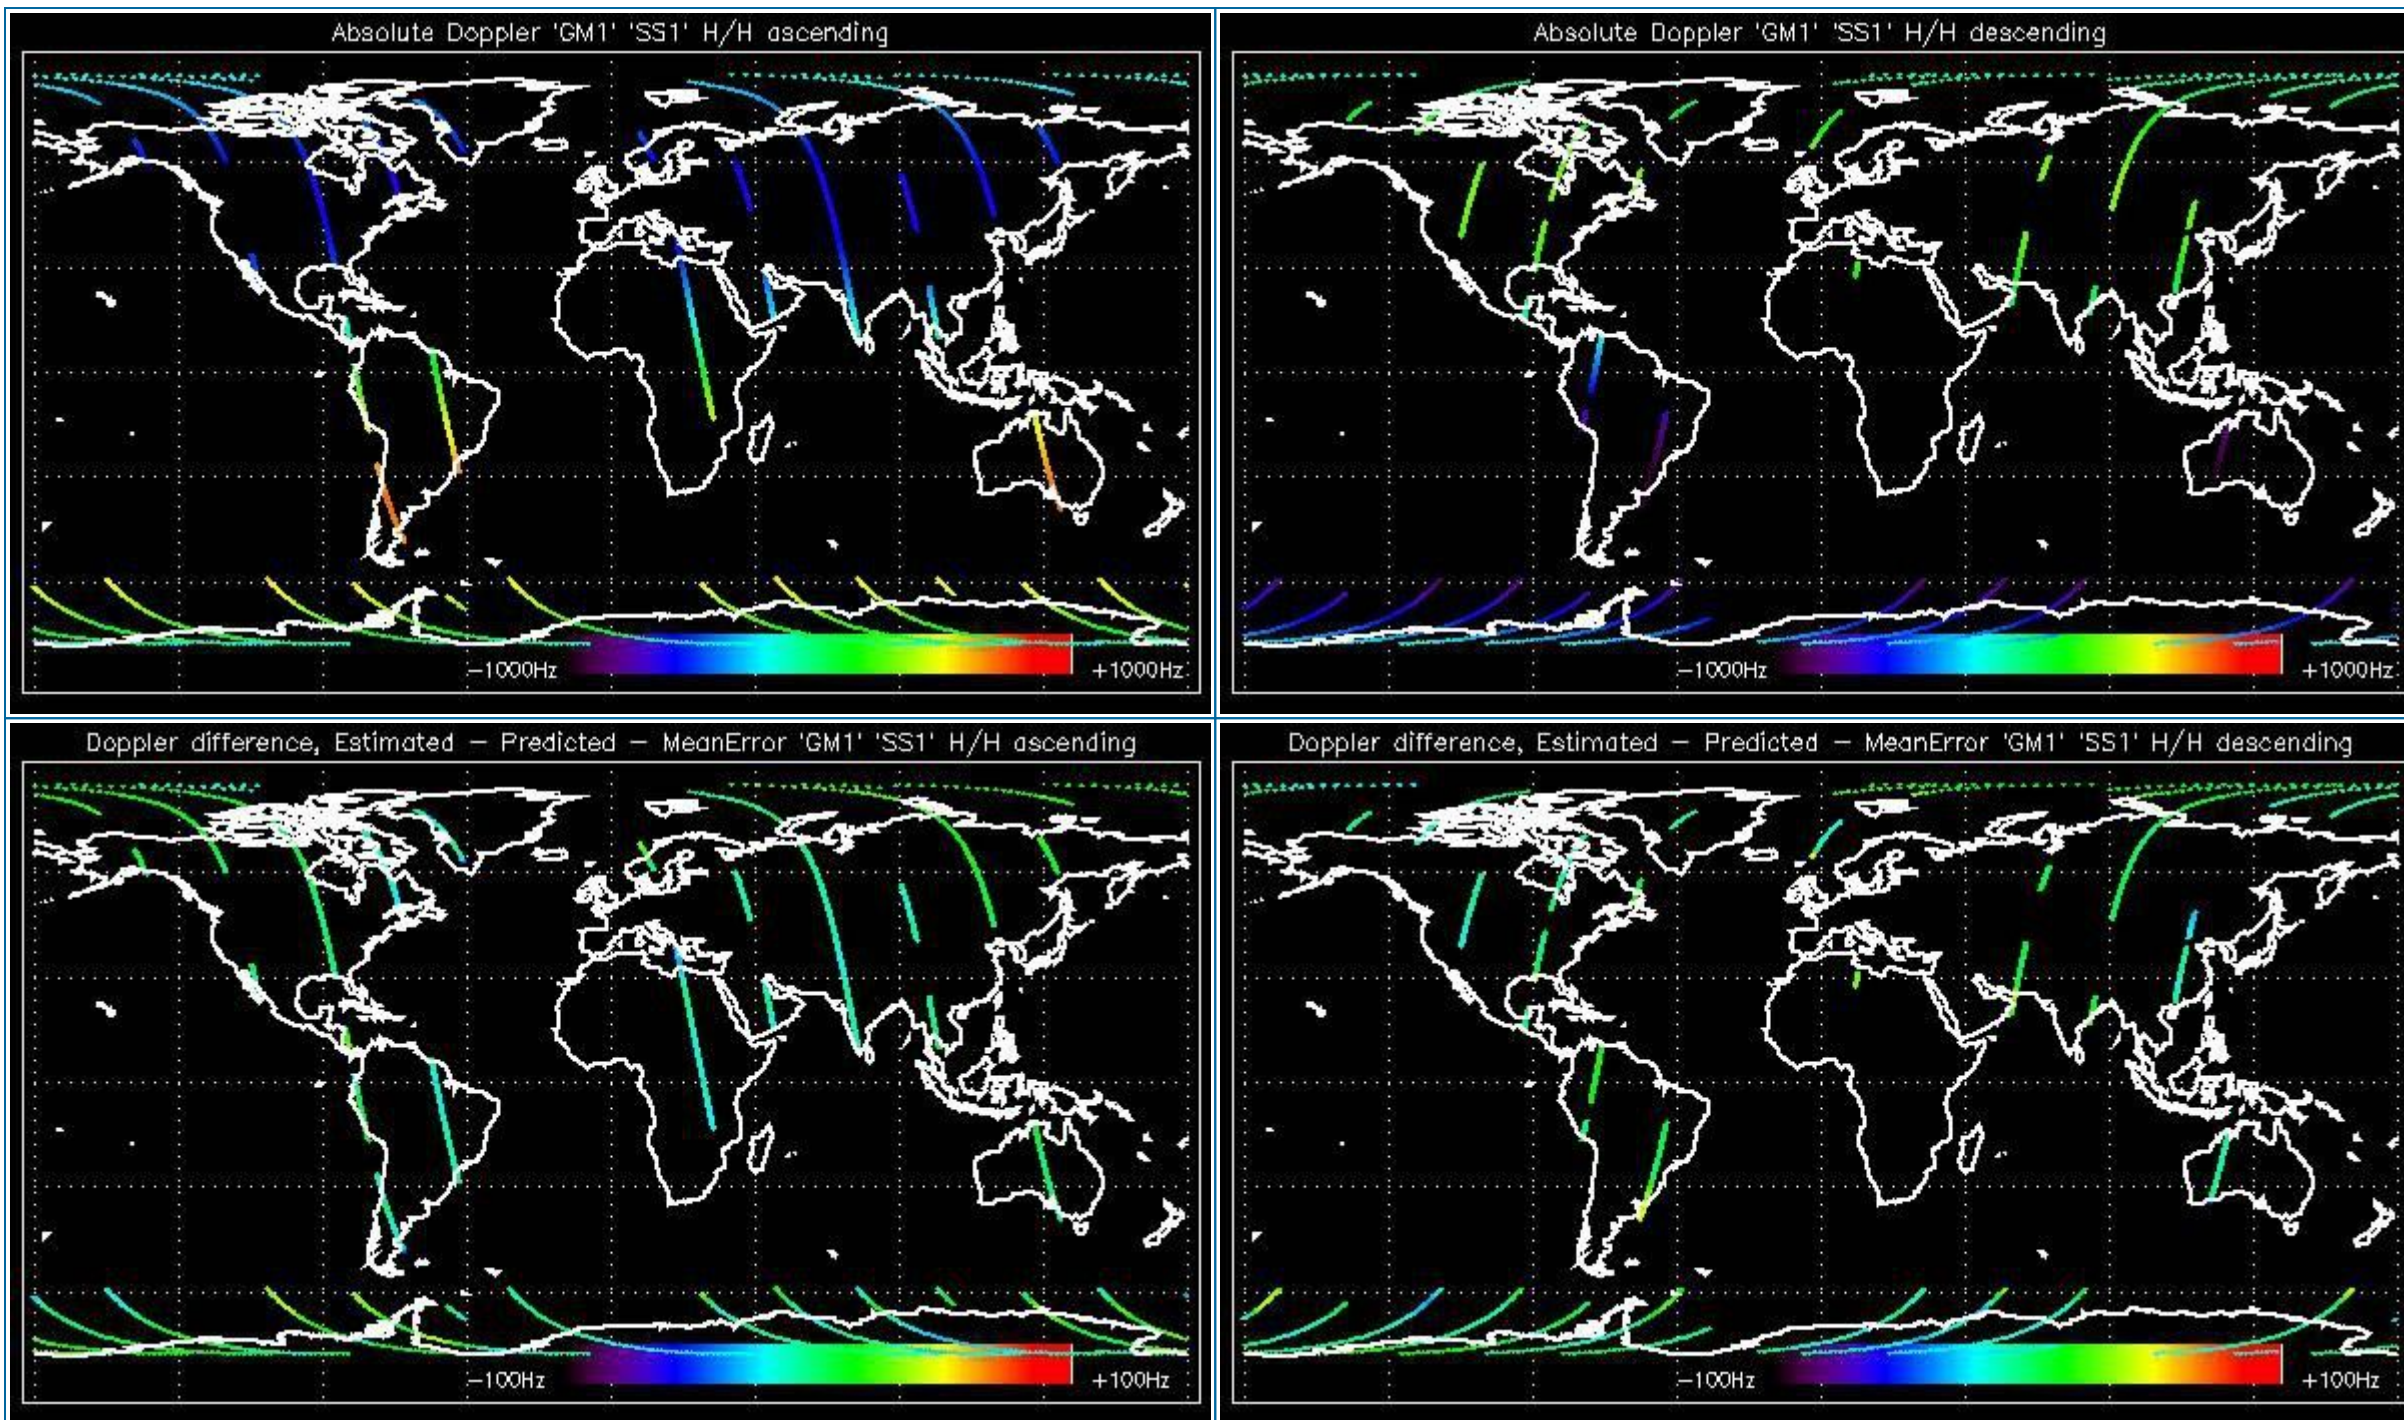

5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




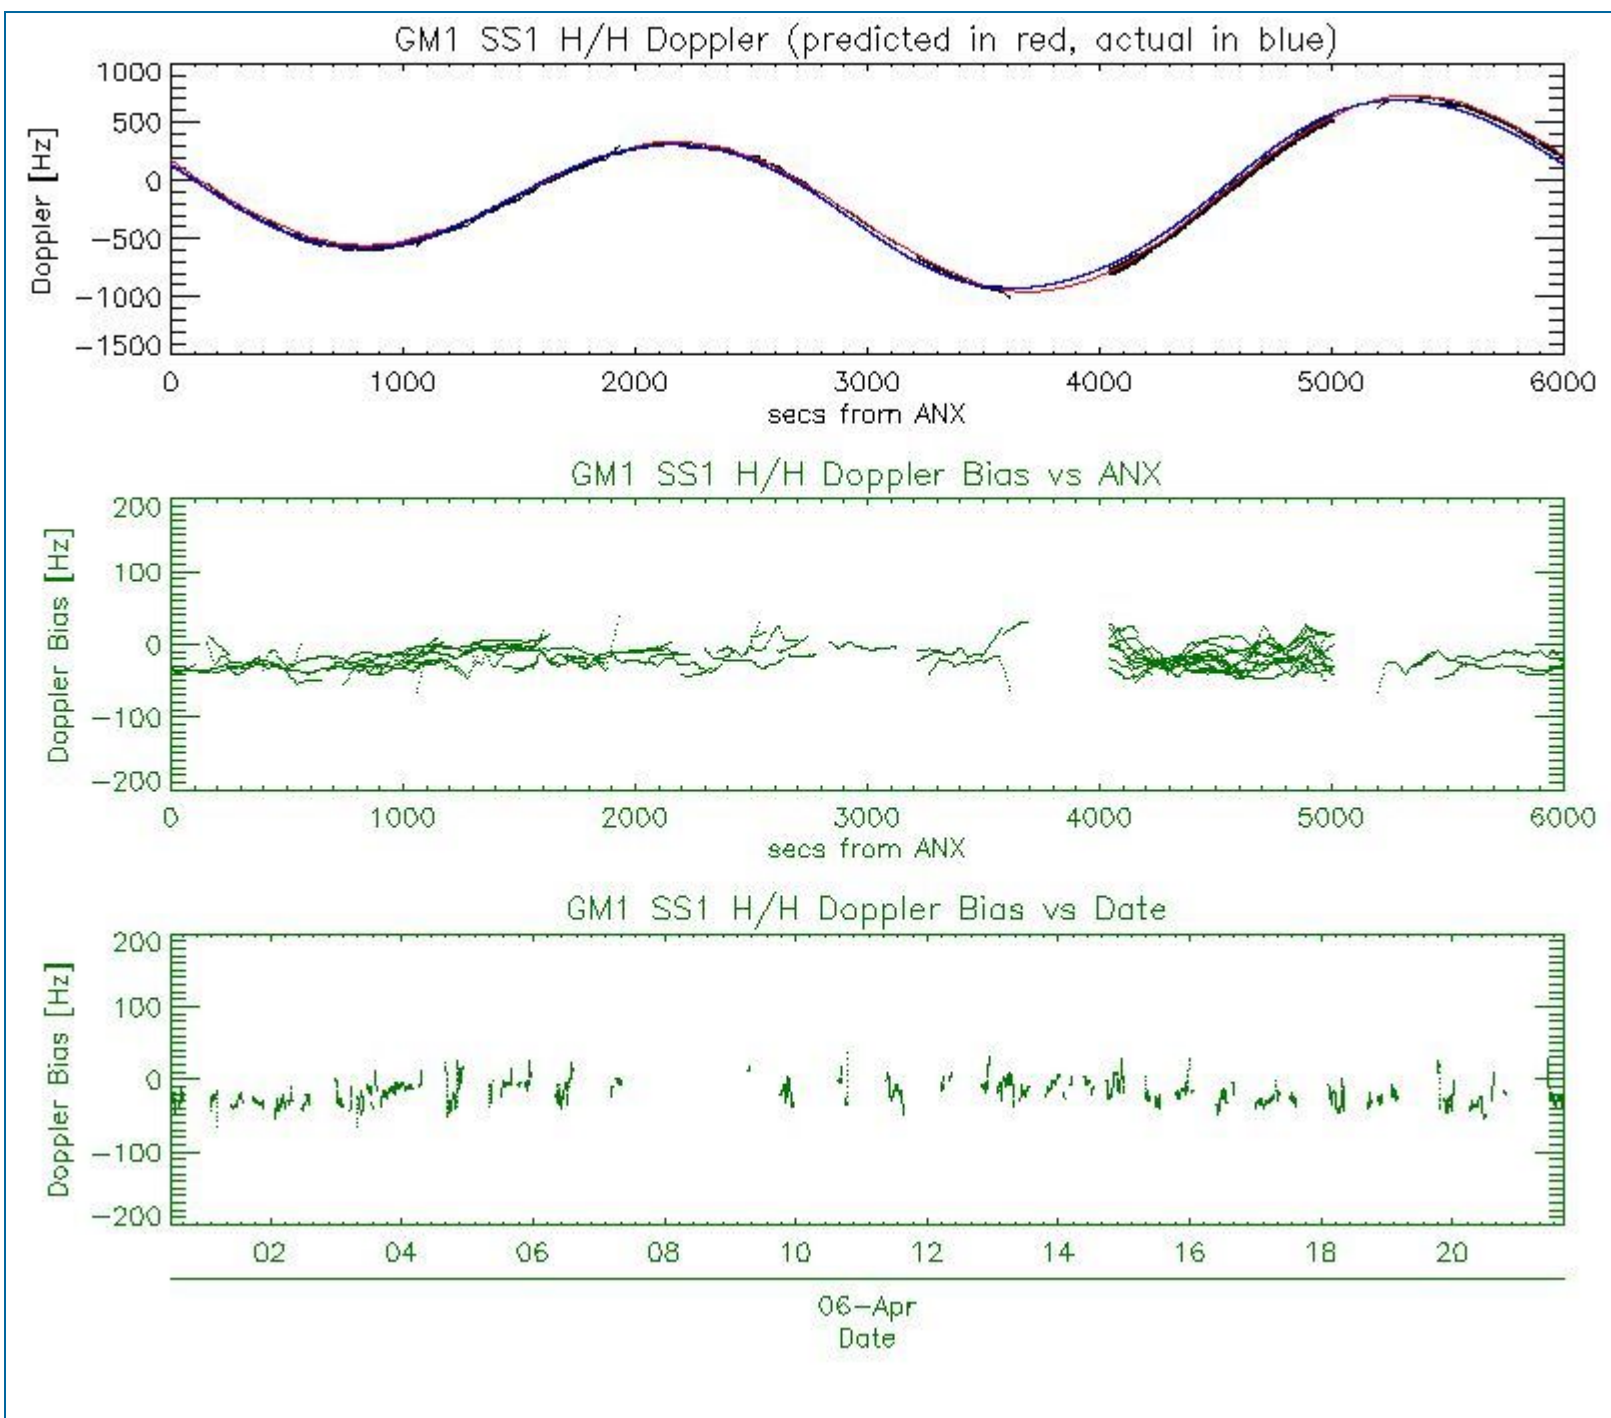

5.3 - Doppler JUMPS Analysis for WSM

[[BACK TO MENU](#)]



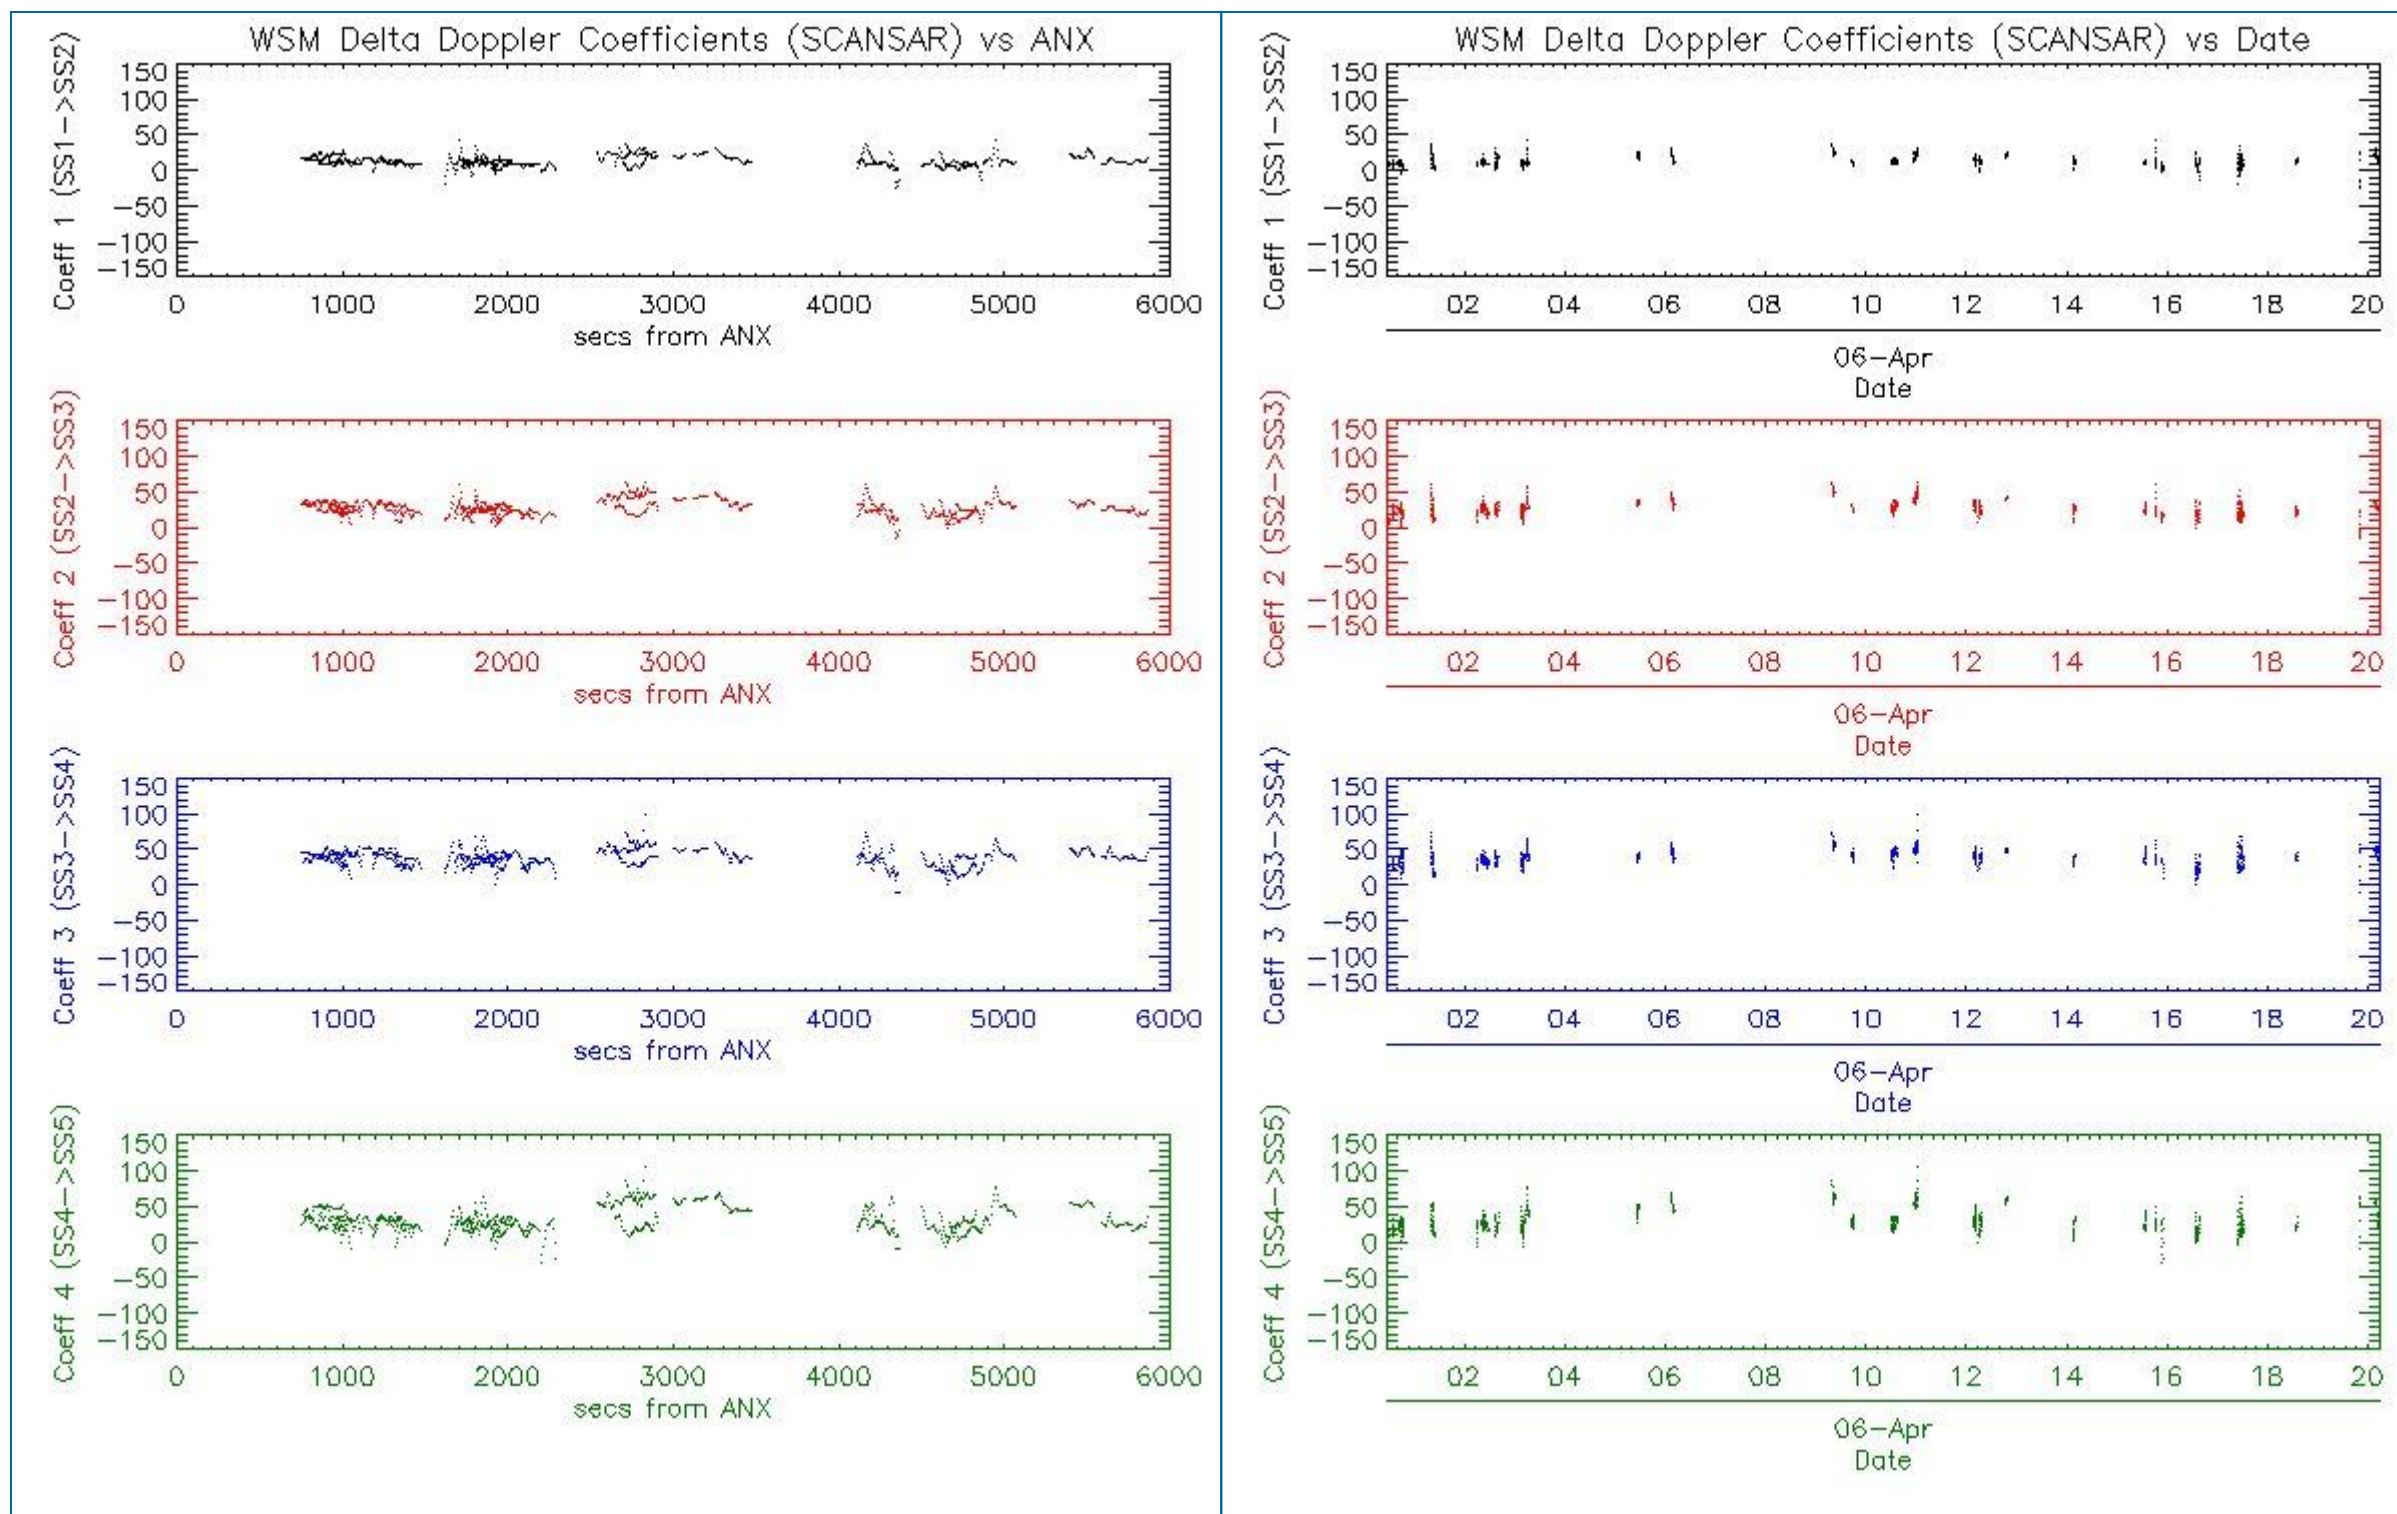



6 - CHIRP ANALYSIS

6.1 - Analysis for WSM SS1 H/H

6.1.1 - ScaleFactor

[BACK TO MENU]





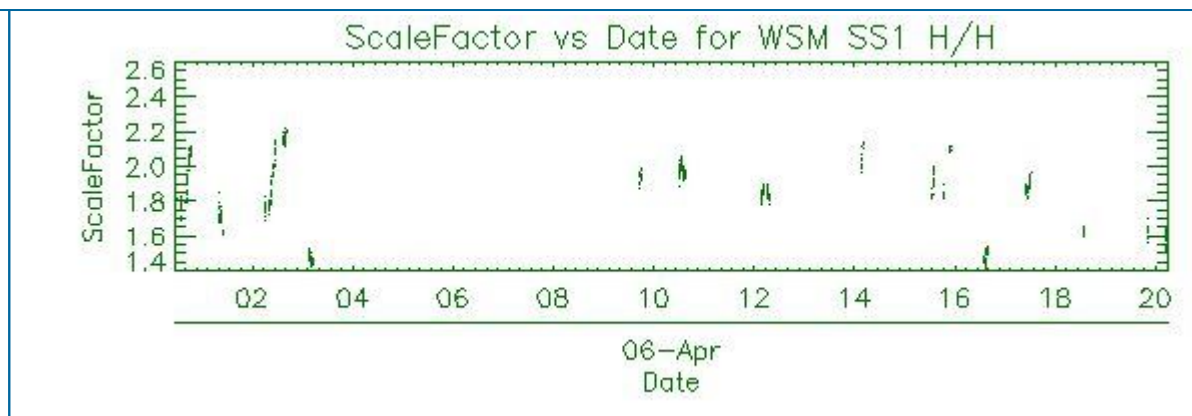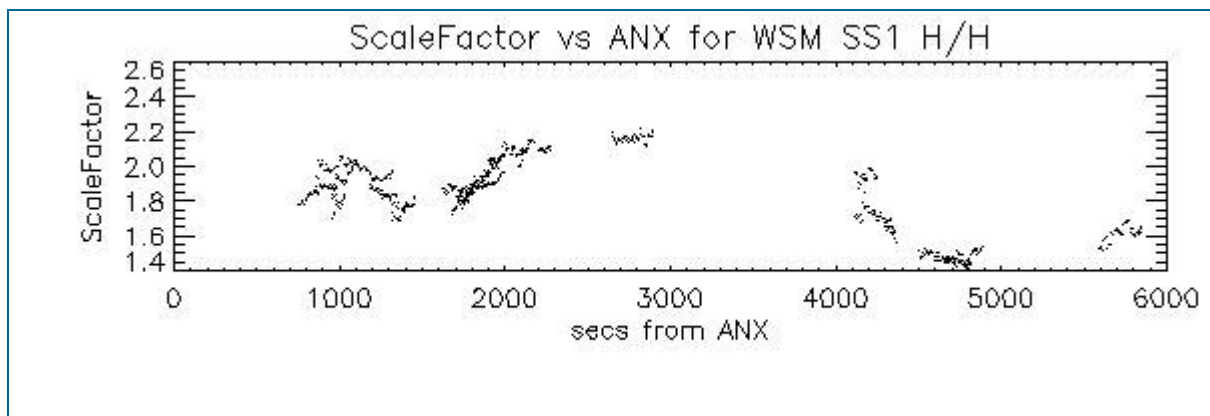

6.2 - Analysis for WSM SS1 V/V

6.2.1 - ScaleFactor

[[BACK TO MENU](#)]


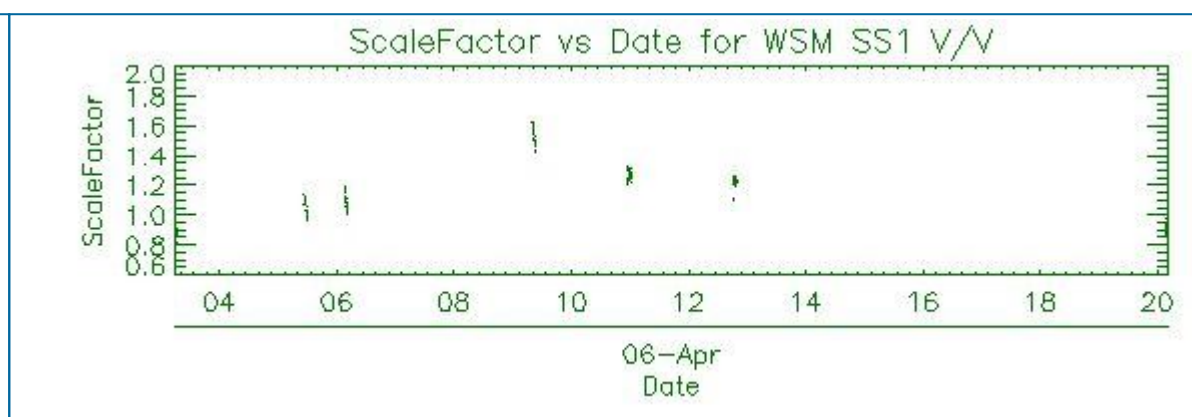
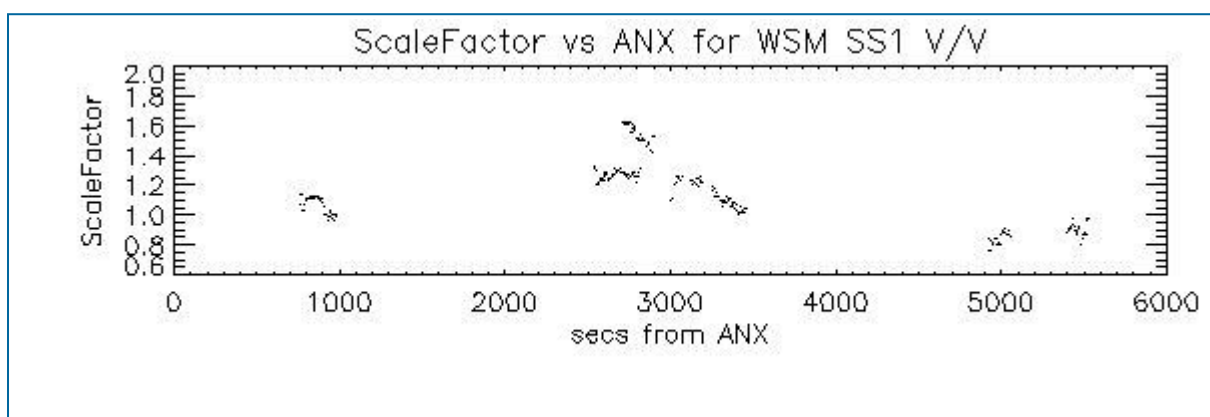


7 - RAW DATA ANALYSIS

7.1 - Analysis for WVS

[[BACK TO MENU](#)]

--	--	--

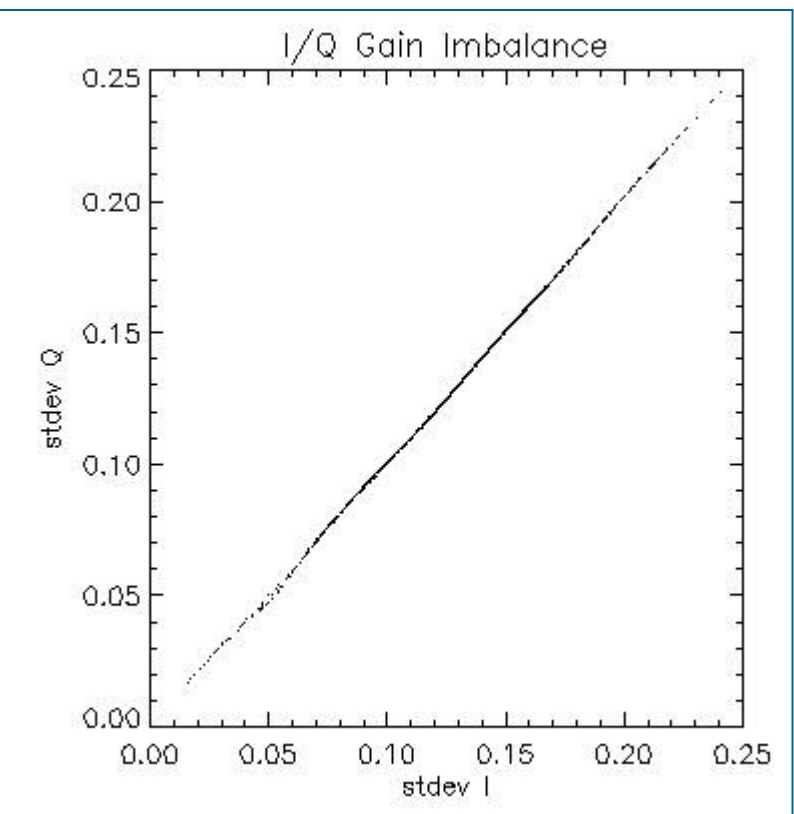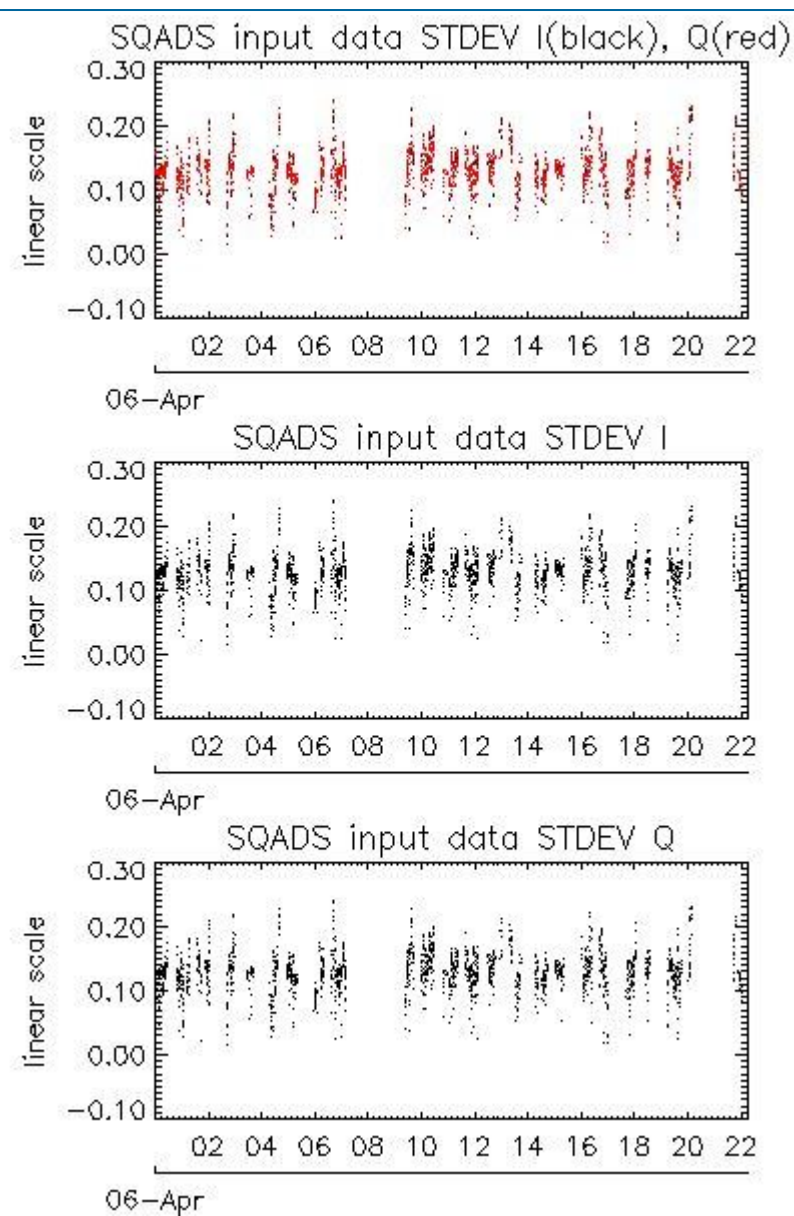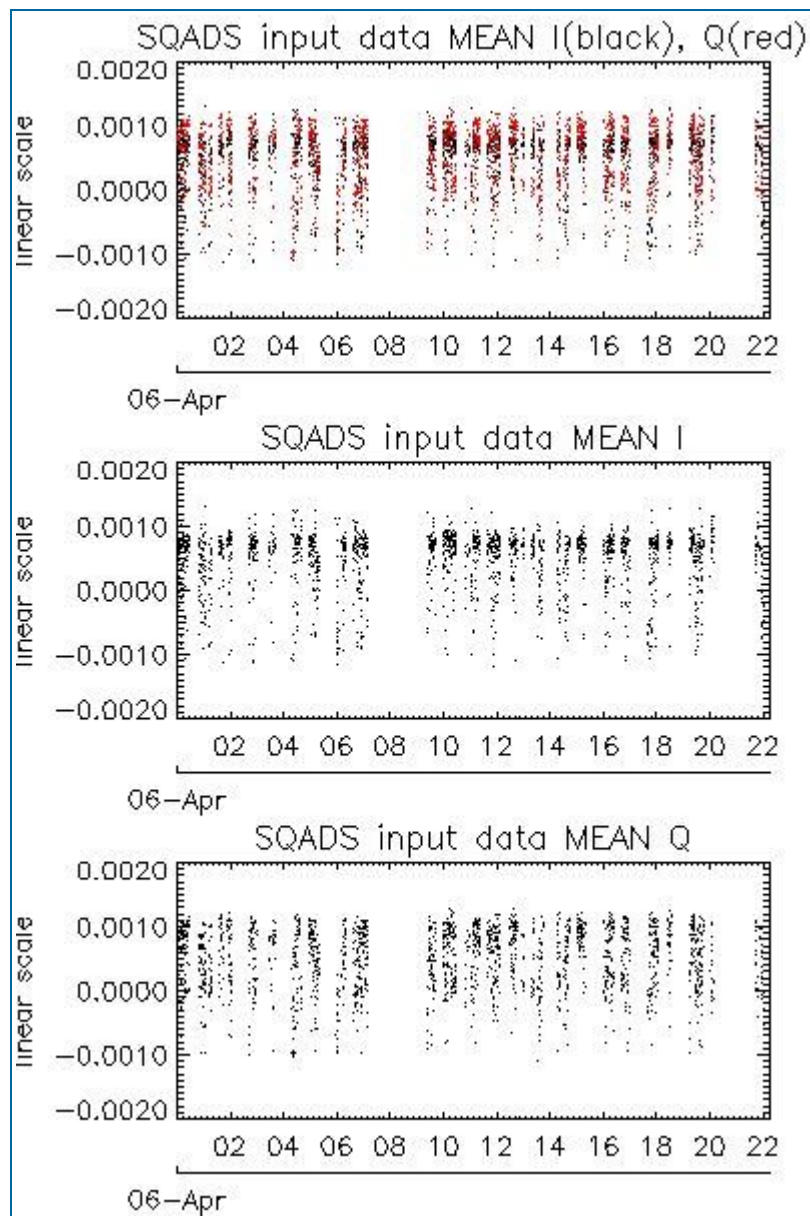


Channel	Statistics	DSS-B
MEAN I	mean	0.000482143
	stdev	2.14775e-07
MEAN Q	mean	0.000506575
	stdev	2.44380e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.129781
	stdev	0.00101890
STDEV Q	mean	0.130112
	stdev	0.00103117

7.2 - Analysis for IMM

[[BACK TO MENU](#)]



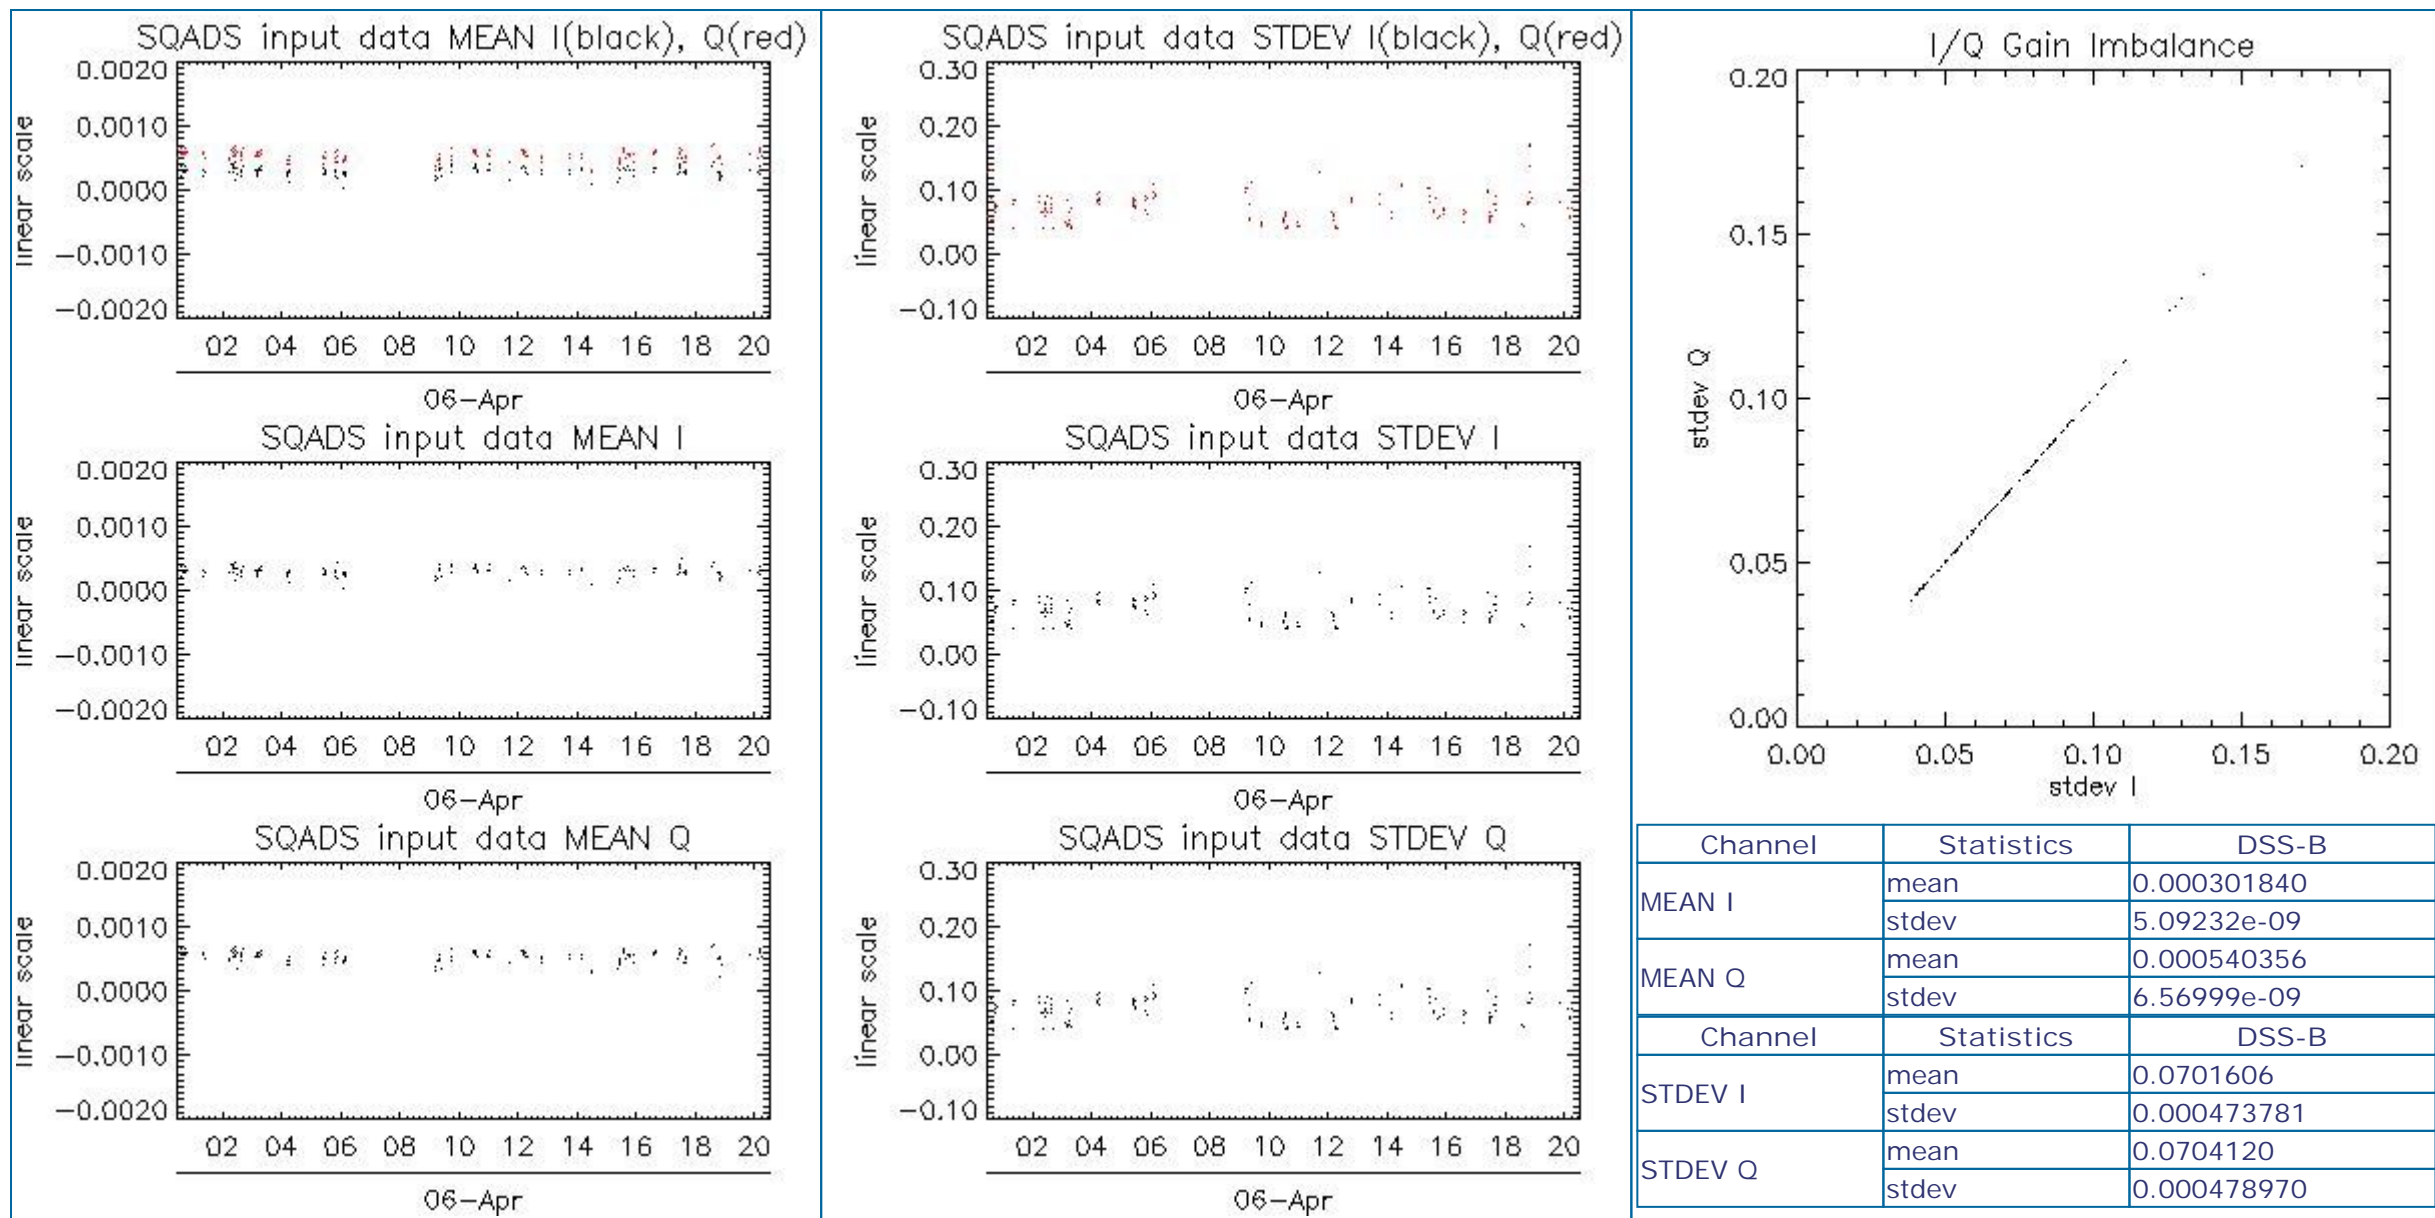


8 - TELEMETRY ANALYSIS

Processing Center	Product	Gaps	Missing lines
PDE	ASA_WSM_1PNPDE20090406_155344_00000912077_00498_37125_4397.N1	0	1

8.1 - Number of Missing lines


[[BACK TO MENU](#)]



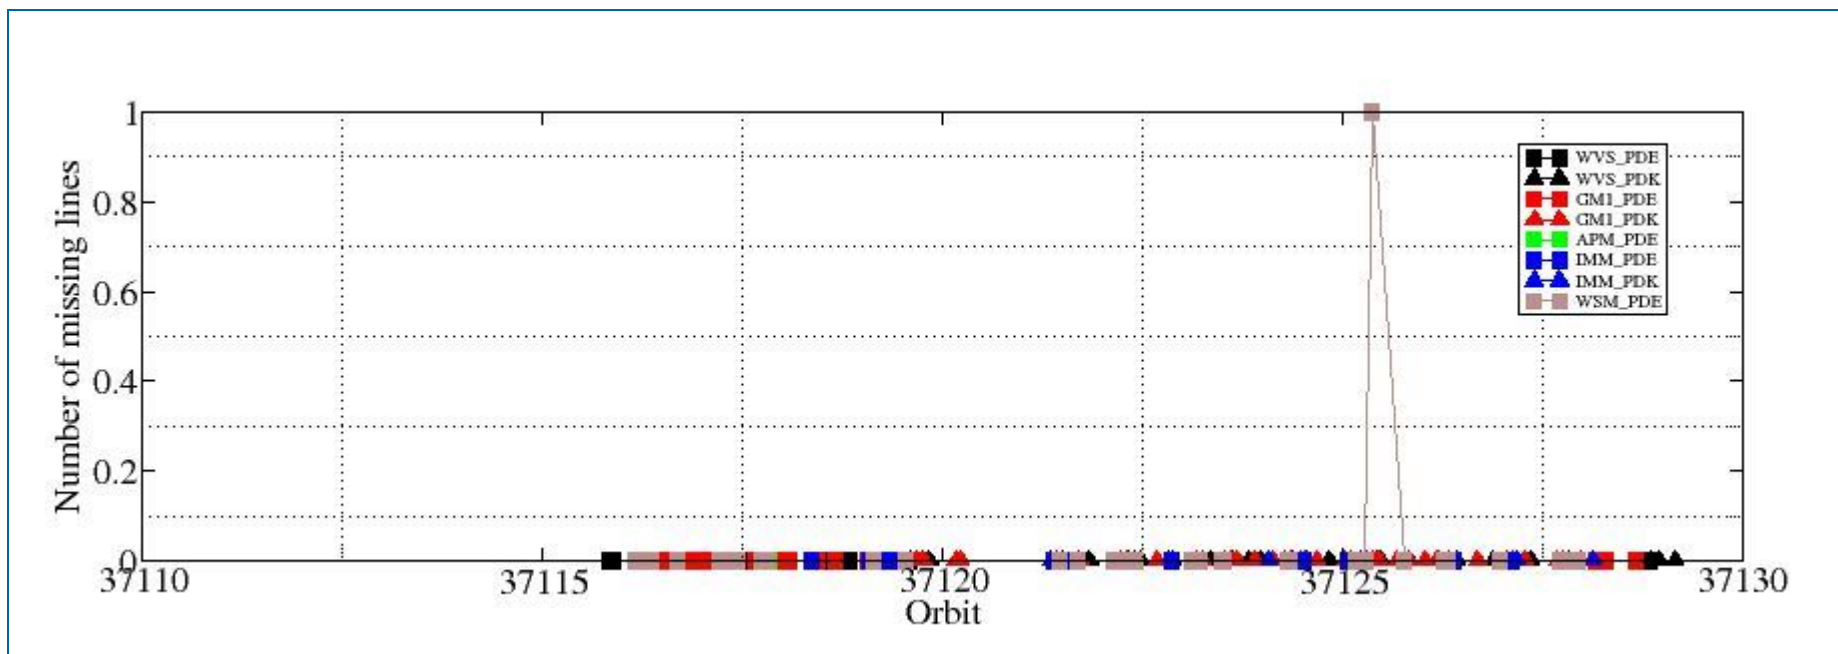

8.2 - Number of Gaps

[[BACK TO MENU](#)]

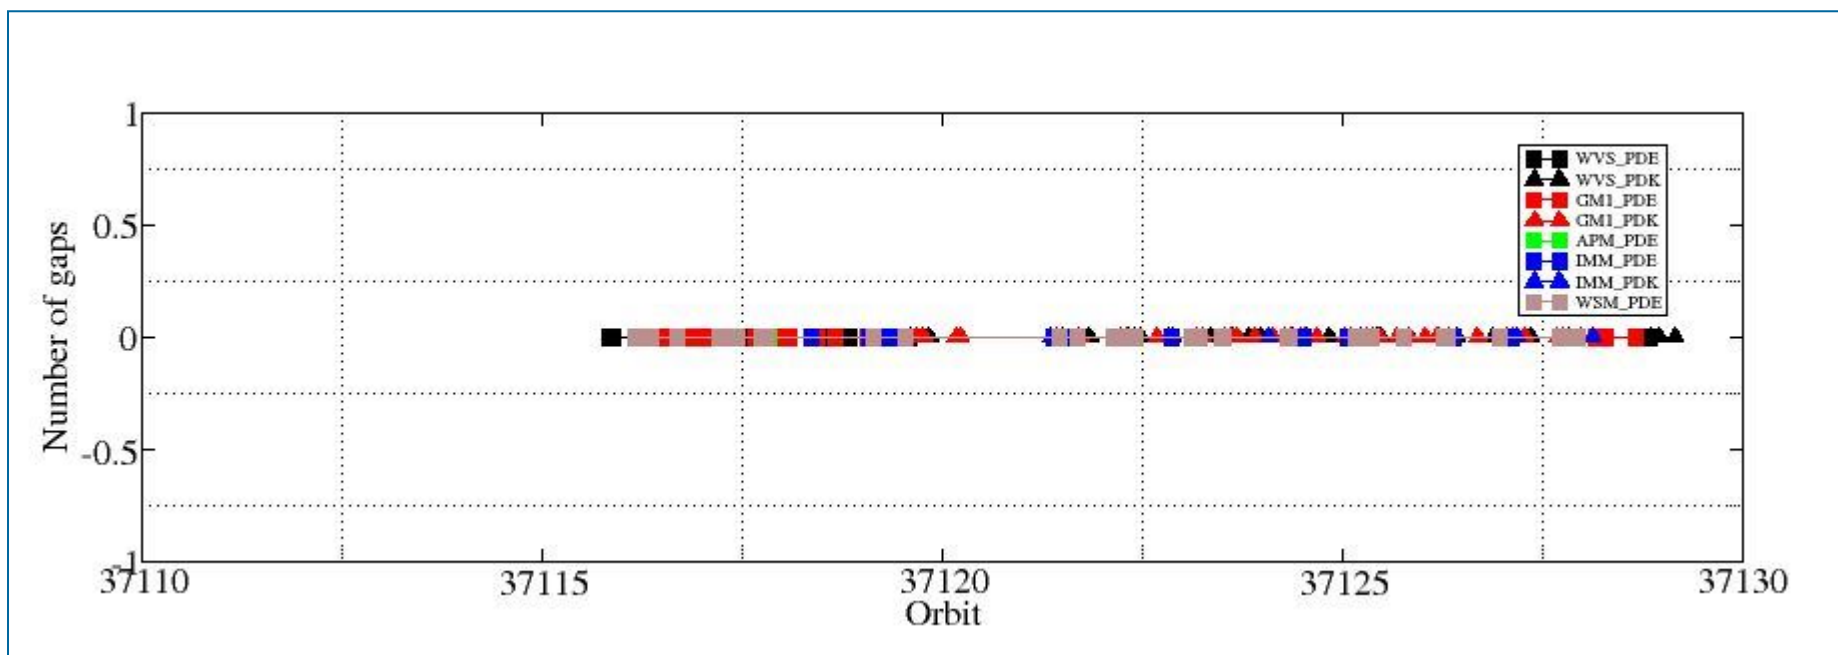

ASAR DAILY REPORT for 090406
#####

MODE: DAILY
ANALYSIS: ALL
DATE: TODAY

Analysis will be performed from 2009-04-06 00:00:00 to 2009-04-06 23:00:05
Results will be exported to the directory: ./RESULTS/DAILY/090406/

DATA SUMMARY

Summary will be performed from 2009-04-06 00:00:00 to 2009-04-06 23:00:05
Results will be exported to the directory: ./RESULTS/DAILY/090406/DATA_SUMMARY

Creating directory ./RESULTS/DAILY/090406/DATA_SUMMARY...
Writing file ./RESULTS/DAILY/090406/DATA_SUMMARY/Data_summary.html...

Getting WVS products list from 2009-04-06 00:00:00 to 2009-04-06 23:00:05...
Writing file ./RESULTS/DAILY/090406/DATA_SUMMARY/List_WVS_products_used.xls...
Writing file ./RESULTS/DAILY/090406/DATA_SUMMARY/List_WVS_products_used.txt...

Getting GM1 products list from 2009-04-06 00:00:00 to 2009-04-06 23:00:05...
Writing file ./RESULTS/DAILY/090406/DATA_SUMMARY/List_GM1_products_used.xls...
Writing file ./RESULTS/DAILY/090406/DATA_SUMMARY/List_GM1_products_used.txt...

Getting APM products list from 2009-04-06 00:00:00 to 2009-04-06 23:00:05...
Writing file ./RESULTS/DAILY/090406/DATA_SUMMARY/List_APM_products_used.xls...
Writing file ./RESULTS/DAILY/090406/DATA_SUMMARY/List_APM_products_used.txt...

Getting IMM products list from 2009-04-06 00:00:00 to 2009-04-06 23:00:05...
Writing file ./RESULTS/DAILY/090406/DATA_SUMMARY/List_IMM_products_used.xls...
Writing file ./RESULTS/DAILY/090406/DATA_SUMMARY/List_IMM_products_used.txt...

Getting WSM products list from 2009-04-06 00:00:00 to 2009-04-06 23:00:05...
Writing file ./RESULTS/DAILY/090406/DATA_SUMMARY/List_WSM_products_used.xls...
Writing file ./RESULTS/DAILY/090406/DATA_SUMMARY/List_WSM_products_used.txt...

Getting MS products list from 2009-04-06 00:00:00 to 2009-04-06 23:00:05...
Writing file ./RESULTS/DAILY/090406/DATA_SUMMARY/List_MS_products_used.xls...
Writing file ./RESULTS/DAILY/090406/DATA_SUMMARY/List_MS_products_used.txt...

DATA SUMMARY completed
#####

AUXILIARY FILES ANALYSIS

Analysis will be performed from 2009-04-06 00:00:00 to 2009-04-06 23:00:05
Results will be exported to the directory: ./RESULTS/DAILY/090406/AUXILIARY

Creating directory ./RESULTS/DAILY/090406/AUXILIARY...

Looking for the IECF operational ADFs list...



Found list 20090406_030001_current_3_IECF_ADFs.txt...
Extracting ADFs...

ASA_CON_AXVIEC20081215_141339_20070204_165113_20091231_000000
ASA_INS_AXVIEC20081215_140905_20070307_060000_20091231_000000
ASA_XCH_AXVIEC20081215_143642_20020301_000000_20091231_000000
ASA_XCA_AXVIEC20090311_104501_20080801_000000_20091231_235959

Writing file ./RESULTS/DAILY/090406/AUXILIARY/ASAR_ADFs_IECF_List3.html...
Writing file ./RESULTS/DAILY/090406/AUXILIARY/Auxiliary_files_summary.html...

Analysing WVS products...

Writing file ./RESULTS/DAILY/090406/AUXILIARY/Check_ADFs_WVS.xls...
Writing file ./RESULTS/DAILY/090406/AUXILIARY/Check_ADFs_WVS.txt...

ASA_WVS_1PNPDE20090406_004836_000010092077_00489_37116_3528.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_011202_000003752077_00489_37116_3531.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_013510_000002402077_00489_37116_3536.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_013825_000002852077_00489_37116_3659.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_015403_000005992077_00490_37117_3670.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_024049_000009742077_00490_37117_3673.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_025649_000001352077_00490_37117_3834.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_032520_000001042077_00490_37117_3827.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_033320_000000892077_00491_37118_3816.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_033710_000001942077_00491_37118_3811.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_041843_000008992077_00491_37118_3854.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_043328_000001502077_00491_37118_3989.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_043801_000000902077_00491_37118_3986.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_045622_000013792077_00491_37118_4020.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_055831_000003142077_00492_37119_4015.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_061128_000001952077_00492_37119_4012.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20090406_214221_000001952077_00501_37128_4496.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_061428_000003452077_00492_37119_2608.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_063658_000019792077_00492_37119_2642.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_092410_000010342077_00494_37121_2774.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_095810_000018442077_00494_37121_2848.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_104735_000000902077_00495_37122_2950.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_105519_000000892077_00495_37122_2953.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_110227_000011692077_00495_37122_2958.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_113845_000001652077_00495_37122_2961.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_114313_000014692077_00495_37122_2976.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_122949_000009142077_00496_37123_3087.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_125730_000001652077_00496_37123_3090.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_131921_000003002077_00496_37123_3095.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_133258_000006452077_00496_37123_3100.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_141458_000004792077_00497_37124_3213.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_143141_000006902077_00497_37124_3220.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_145957_000011242077_00497_37124_3229.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_155922_000000742077_00498_37125_3341.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_160324_000012142077_00498_37125_3348.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_164033_000011092077_00498_37125_3357.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_174053_000014092077_00499_37126_3469.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_182527_000004642077_00499_37126_3466.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_191351_000018592077_00500_37127_3583.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_200145_000003452077_00500_37127_3588.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_214451_000001202077_00501_37128_3695.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_215359_000003742077_00501_37128_3698.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20090406_221348_000000602078_00001_37129_3701.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing GM1 products...

Writing file ./RESULTS/DAILY/090406/AUXILIARY/Check_ADFs_GM1.xls...

Analysing APM products...

Writing file ./RESULTS/DAILY/090406/AUXILIARY/Check_ADFs_APM.xls...

Writing file ./RESULTS/DAILY/090406/AUXILIARY/Check_ADFs_APM.txt...

ASA_APM_1PNPDE20090406_031648_00000562077_00490_37117_3800.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing IMM products...

Writing file ./RESULTS/DAILY/090406/AUXILIARY/Check_ADFs_IMM.xls...

Writing file ./RESULTS/DAILY/090406/AUXILIARY/Check_ADFs_IMM.txt...

ASA_IMM_1PNPDE20090406_021303_00000532077_00490_37117_3738.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_022501_00000672077_00490_37117_3771.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_023103_00000342077_00490_37117_3756.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_041009_000002422077_00491_37118_3943.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_041009_000003632077_00491_37118_3947.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_052249_000001572077_00492_37119_3975.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_054825_000001272077_00492_37119_3971.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_055106_00000822077_00492_37119_3973.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_060418_000001272077_00492_37119_4085.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_091316_00000372077_00494_37121_4200.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_091527_00000372077_00494_37121_4206.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_092313_00000532077_00494_37121_4208.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_114204_00000632077_00495_37122_4297.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_142833_00000762077_00497_37124_4365.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_152344_000002612077_00498_37125_4399.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_173711_000002152077_00499_37126_4445.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_184608_000001842077_00500_37127_4449.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20090406_184952_00000672077_00500_37127_4429.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20090406_091053_00000402077_00494_37121_2753.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20090406_134425_00000822077_00497_37124_3191.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20090406_153913_000001142077_00498_37125_3318.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20090406_185509_00000362077_00500_37127_3480.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20090406_203043_00000162077_00501_37128_3576.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing WSM products...

Writing file ./RESULTS/DAILY/090406/AUXILIARY/Check_ADFs_WSM.xls...

Writing file ./RESULTS/DAILY/090406/AUXILIARY/Check_ADFs_WSM.txt...

ASA_WSM_1PNPDE20090406_002737_00000972077_00489_37116_3654.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_003343_000001522077_00489_37116_3656.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_004037_000001902077_00489_37116_3744.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_004037_000004152077_00489_37116_3851.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_004448_000000612077_00489_37116_3648.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_004650_00000422077_00489_37116_3652.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_012014_000002502077_00489_37116_3762.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_021419_000001092077_00490_37117_3783.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_022013_000001342077_00490_37117_3798.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_022013_000002692077_00490_37117_3916.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_022322_000000612077_00490_37117_3779.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_022655_000001162077_00490_37117_3796.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_023620_000002692077_00490_37117_3785.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_030718_00000732077_00490_37117_3856.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_030718_000003302077_00490_37117_4101.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_031027_000001412077_00490_37117_3945.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_031416_000001532077_00490_37117_3939.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

ASA_WSM_1PNPDE20090406_052606_000001892077_00492_37119_4116.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_052606_000002442077_00492_37119_4180.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_060740_000002252077_00492_37119_4118.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_091950_000001902077_00494_37121_4229.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_094313_000001532077_00494_37121_4286.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_102931_000000732077_00495_37122_4268.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_102931_000004902077_00495_37122_4326.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_103146_000001762077_00495_37122_4300.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_103544_000000612077_00495_37122_4280.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_105730_000002992077_00495_37122_4284.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_120826_000002452077_00496_37123_4324.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_121534_000000732077_00496_37123_4312.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_121534_000001762077_00496_37123_4347.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_121748_000000422077_00496_37123_4316.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_124552_000000732077_00496_37123_4302.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_124752_000000912077_00496_37123_4319.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_140802_000001352077_00497_37124_4405.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_140916_000000612077_00497_37124_4363.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_153255_000001532077_00498_37125_4355.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_154533_000001102077_00498_37125_4403.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_155344_000000912077_00498_37125_4397.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_163351_000003062077_00498_37125_4401.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_172436_000001352077_00499_37126_4451.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_172436_000003912077_00499_37126_4475.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_172847_000001392077_00499_37126_4452.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_183354_000000912077_00499_37126_4447.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_195002_000000612077_00500_37127_4471.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_200810_000001532077_00500_37127_4483.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20090406_201120_000001902077_00500_37127_4485.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

AUXILIARY FILES ANALYSIS completed

#####

MODULE STEPPING ANALYSIS

#####

Analysis will be performed from 2009-04-06 00:00:00 to 2009-04-06 23:00:05

Results will be exported to the directory: ./RESULTS/DAILY/090406/MODULE_STEPPING

Creating directory ./RESULTS/DAILY/090406/MODULE_STEPPING...

Creating directory ./RESULTS/DAILY/090406/MODULE_STEPPING/FIRST_REFERENCE...

Creating directory ./RESULTS/DAILY/090406/MODULE_STEPPING/SECOND_REFERENCE...

Creating directory ./RESULTS/DAILY/090406/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Deleting old files...

Creating images comparing with second reference...

Exporting results to the directory ../../RESULTS/DAILY/090406/MODULE_STEPPING/SECOND_REFERENCE...

Polarization: H

Reference product: ASA_MS__0PNPDK20050922_062651_000000152041_00034_18625_0041.N1

Test product: ASA_MS__0PNPDK20090406_090709_000000162077_00494_37121_0778.N1

H

H

../../RESULTS/DAILY/090406/MODULE_STEPPING/SECOND_REFERENCE/TGH_20090406_090709-20050922_062651.png

../../RESULTS/DAILY/090406/MODULE_STEPPING/SECOND_REFERENCE/TPH_20090406_090709-20050922_062651.png

../../RESULTS/DAILY/090406/MODULE_STEPPING/SECOND_REFERENCE/RGH_20090406_090709-20050922_062651.png

../../RESULTS/DAILY/090406/MODULE_STEPPING/SECOND_REFERENCE/RPH_20090406_090709-20050922_062651.png

Polarization: V

Reference product: ASA_MS__0PNPDK20050923_055514_000000152041_00048_18639_0042.N1

Test product: ASA_MS__0PNPDK20090406_180503_000000162077_00499_37126_0779.N1

V

V
.././RESULTS/DAILY/090406/MODULE_STEPPING/SECOND_REFERENCE/TGV_20090406_180503-20050923_055514.png
.././RESULTS/DAILY/090406/MODULE_STEPPING/SECOND_REFERENCE/TPV_20090406_180503-20050923_055514.png
.././RESULTS/DAILY/090406/MODULE_STEPPING/SECOND_REFERENCE/RGV_20090406_180503-20050923_055514.png
.././RESULTS/DAILY/090406/MODULE_STEPPING/SECOND_REFERENCE/RPV_20090406_180503-20050923_055514.png

Creating images comparing with previous product reference...

Exporting results to the directory .././RESULTS/DAILY/090406/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Polarization: H
Reference product: ASA_MS__0PNPDK20090405_183640_000000162077_00485_37112_0777.N1
Test product: ASA_MS__0PNPDK20090406_090709_000000162077_00494_37121_0778.N1

H
H
.././RESULTS/DAILY/090406/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGH_20090406_090709-20090405_183640.png
.././RESULTS/DAILY/090406/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPH_20090406_090709-20090405_183640.png
.././RESULTS/DAILY/090406/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGH_20090406_090709-20090405_183640.png
.././RESULTS/DAILY/090406/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPH_20090406_090709-20090405_183640.png

Polarization: V
Reference product: ASA_MS__0PNPDE20090404_204853_000000162077_00472_37099_0404.N1
Test product: ASA_MS__0PNPDK20090406_180503_000000162077_00499_37126_0779.N1

V
V
.././RESULTS/DAILY/090406/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGV_20090406_180503-20090404_204853.png
.././RESULTS/DAILY/090406/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPV_20090406_180503-20090404_204853.png
.././RESULTS/DAILY/090406/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGV_20090406_180503-20090404_204853.png
.././RESULTS/DAILY/090406/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPV_20090406_180503-20090404_204853.png

MODULE_STEPPING ANALYSIS completed
#####

CALIBRATION PULSES ANALYSIS

Creating directory ./RESULTS/DAILY/090406/CALIBRATION_PULSES...

ALL ROWS Analysis will be performed from 2009-04-06 00:00:00 to 2009-04-06 23:00:05

Analysing products WVS IS2 V/V
Writing image .././RESULTS/DAILY/090406//CALIBRATION_PULSES/Calibration_pulses_all_rows_WVS_IS2_VV.png...
Analysing products GM1 SS3 H/H
Writing image .././RESULTS/DAILY/090406//CALIBRATION_PULSES/Calibration_pulses_all_rows_GM1_SS3_HH.png...

TEMPORAL EVOLUTION Analysis will be performed from 2009-04-06 00:00:00 to 2009-04-06 23:00:05

Analysing products WVS IS2 V/V
Getting calibration pulses data for WVS IS2 V/V from 2009-04-06 00:00:00 to 2009-04-06 23:00:05. Rows: 1/5/9/13/17/21/25/29
Writing file ./RESULTS/DAILY/090406/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-04-06_1.dat...
Writing .././RESULTS/DAILY/090406//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_1.png...
Writing .././RESULTS/DAILY/090406//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2009-04-06 00:00:00 to 2009-04-06 23:00:05. Rows: 2/6/10/14/18/22/26/30
Writing file ./RESULTS/DAILY/090406/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-04-06_2.dat...
Writing .././RESULTS/DAILY/090406//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_2.png...
Writing .././RESULTS/DAILY/090406//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2009-04-06 00:00:00 to 2009-04-06 23:00:05. Rows: 3/7/11/15/19/23/27/31
Writing file ./RESULTS/DAILY/090406/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-04-06_3.dat...
Writing ../../RESULTS/DAILY/090406//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_3.png...
Writing ../../RESULTS/DAILY/090406//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2009-04-06 00:00:00 to 2009-04-06 23:00:05. Rows: 4/8/12/16/20/24/28/32
Writing file ./RESULTS/DAILY/090406/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2009-04-06_4.dat...
Writing ../../RESULTS/DAILY/090406//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_4.png...
Writing ../../RESULTS/DAILY/090406//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_4.png...

Analysing products GM1 SS3 H/H

Getting calibration pulses data for GM1 SS3 H/H from 2009-04-06 00:00:00 to 2009-04-06 23:00:05. Rows: 1/5/9/13/17/21/25/29
Writing file ./RESULTS/DAILY/090406/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-04-06_1.dat...
Writing ../../RESULTS/DAILY/090406//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_1.png...
Writing ../../RESULTS/DAILY/090406//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_1.png...

Getting calibration pulses data for GM1 SS3 H/H from 2009-04-06 00:00:00 to 2009-04-06 23:00:05. Rows: 2/6/10/14/18/22/26/30
Writing file ./RESULTS/DAILY/090406/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-04-06_2.dat...
Writing ../../RESULTS/DAILY/090406//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_2.png...
Writing ../../RESULTS/DAILY/090406//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2009-04-06 00:00:00 to 2009-04-06 23:00:05. Rows: 3/7/11/15/19/23/27/31
Writing file ./RESULTS/DAILY/090406/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-04-06_3.dat...
Writing ../../RESULTS/DAILY/090406//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_3.png...
Writing ../../RESULTS/DAILY/090406//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2009-04-06 00:00:00 to 2009-04-06 23:00:05. Rows: 4/8/12/16/20/24/28/32
Writing file ./RESULTS/DAILY/090406/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2009-04-06_4.dat...
Writing ../../RESULTS/DAILY/090406//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_4.png...
Writing ../../RESULTS/DAILY/090406//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_4.png...

CALIBRATION PULSES ANALYSIS completed

#####

DOPPLER ANALYSIS

#####

Creating directory ./RESULTS/DAILY/090406/DOPPLER...

DOPPLER ANX Analysis will be performed from 2009-04-06 00:00:00 to 2009-04-06 23:00:05

Analysing products WVS IS2 V/V

Getting doppler data for WVS IS2 V/V from 2009-04-06 00:00:00 to 2009-04-06 23:00:05...
Writing file ./RESULTS/DAILY/090406/DOPPLER/Doppler_data_WVS_IS2_VV_2009-04-06.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/090406/DOPPLER/DOPPLER_ANX_WVS_IS2_VV.png...

Analysing products GM1 SS1 H/H

Getting doppler data for GM1 SS1 H/H from 2009-04-06 00:00:00 to 2009-04-06 23:00:05...
Writing file ./RESULTS/DAILY/090406/DOPPLER/Doppler_data_GM1_SS1_HH_2009-04-06.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/090406/DOPPLER/DOPPLER_ANX_GM1_SS1_HH.png...

DOPPLER JUMPS Analysis will be performed on WSM products from 2009-04-06 00:00:00 to 2009-04-06 23:00:05

Analysing by default products WSM
Getting doppler jumps data for WSM from 2009-04-06 00:00:00 to 2009-04-06 23:00:05...
Writing file ./RESULTS/DAILY/090406/DOPPLER/Doppler_Jumps_data_WSM_2009-04-06.dat...
Running IDL program...
Writing file ../RESULTS/DAILY/090406/DOPPLER/DOPPLER_JUMPS_ANX_WSM.png...
Writing file ../RESULTS/DAILY/090406/DOPPLER/DOPPLER_JUMPS_Date_WSM.png...

DOPPLER MAP Analysis will be performed from 2009-04-06 00:00:00 to 2009-04-06 23:00:05

Analysing products WVS IS2 V/V
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -30.590124 Hz
Writing file ../RESULTS/DAILY/090406//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_desc.jpg...
Writing file ../RESULTS/DAILY/090406//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_desc.jpg...

Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -27.584932 Hz
Writing file ../RESULTS/DAILY/090406//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_asc.jpg...
Writing file ../RESULTS/DAILY/090406//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_asc.jpg...

Analysing products GM1 SS1 H/H
Loading predicted doppler values....
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -16.215487 Hz
Writing file ../RESULTS/DAILY/090406//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_desc.jpg...
Writing file ../RESULTS/DAILY/090406//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_desc.jpg...

Loading predicted doppler values....
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -20.451759 Hz
Writing file ../RESULTS/DAILY/090406//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_asc.jpg...
Writing file ../RESULTS/DAILY/090406//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_asc.jpg...

DOPPLER ANALYSIS completed
#####

CHIRP ANALYSIS

Creating directory ./RESULTS/DAILY/090406/CHIRP...

CHIRP Analysis will be performed from 2009-04-06 00:00:00 to 2009-04-06 23:00:05

Analysing products WSM SS1 H/H

Getting ScaleFactor data for WSM SS1 H/H from 2009-04-06 00:00:00 to 2009-04-06 23:00:05...
Writing file ./RESULTS/DAILY/090406/CHIRP/ScaleFactor_data_WSM_SS1_HH_2009-04-06.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/090406/CHIRP/ScaleFactor_ANX_WSM_SS1_HH.png...
Writing file ../../RESULTS/DAILY/090406/CHIRP/ScaleFactor_DATE_WSM_SS1_HH.png...

Analysing products WSM SS1 V/V

Getting ScaleFactor data for WSM SS1 V/V from 2009-04-06 00:00:00 to 2009-04-06 23:00:05...
Writing file ./RESULTS/DAILY/090406/CHIRP/ScaleFactor_data_WSM_SS1_VV_2009-04-06.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/090406/CHIRP/ScaleFactor_ANX_WSM_SS1_VV.png...
Writing file ../../RESULTS/DAILY/090406/CHIRP/ScaleFactor_DATE_WSM_SS1_VV.png...

CHIRP ANALYSIS completed

#####

RAW DATA ANALYSIS

Analysis will be performed from 2009-04-06 00:00:00 to 2009-04-06 23:00:05
Results will be exported to the directory: ./RESULTS/DAILY/090406/RAW_DATA

Creating directory ./RESULTS/DAILY/090406/RAW_DATA...

Getting raw data for WVS from 2009-04-06 00:00:00 to 2009-04-06 23:00:05...
Writing file ./RESULTS/DAILY/090406/RAW_DATA/Raw_data_WVS_2009-04-06.dat...
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/090406/RAW_DATA/Raw_data_WVS_input_mean.png...
Creating image ../../RESULTS/DAILY/090406/RAW_DATA/Raw_data_WVS_input_stdev.png...
Creating image ../../RESULTS/DAILY/090406/RAW_DATA/Raw_data_WVS_gain_imbalance.png...

Getting raw data for IMM from 2009-04-06 00:00:00 to 2009-04-06 23:00:05...
Writing file ./RESULTS/DAILY/090406/RAW_DATA/Raw_data_IMM_2009-04-06.dat...
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/090406/RAW_DATA/Raw_data_IMM_input_mean.png...
Creating image ../../RESULTS/DAILY/090406/RAW_DATA/Raw_data_IMM_input_stdev.png...
Creating image ../../RESULTS/DAILY/090406/RAW_DATA/Raw_data_IMM_gain_imbalance.png...

RAW DATA ANALYSIS completed

#####

TELEMETRY ANALYSIS

Analysis will be performed from 2009-04-06 00:00:00 to 2009-04-06 23:00:05
Results will be exported to the directory: ./RESULTS/DAILY/090406/TELEMETRY

Creating directory ./RESULTS/DAILY/090406/TELEMETRY...

Looking for gaps and missing lines in WVS products...

Checking 19 products from PDE...
Checking 26 products from PDK...

Looking for gaps and missing lines in GM1 products...

Checking 26 products from PDE...
Checking 39 products from PDK...

Looking for gaps and missing lines in APM products...

Checking 1 products from PDE...
No products from PDK...

Looking for gaps and missing lines in IMM products...

Checking 18 products from PDE...
Checking 5 products from PDK...

Looking for gaps and missing lines in WSM products...

Checking 46 products from PDE...
Found product...ASA_WSM_1PNPDE20090406_155344_00000912077_00498_37125_4397.N1 / 0 gaps / 1 missing lines
No products from PDK...

Creating graph of missing lines and gaps...

Creating image: ./RESULTS/DAILY/090406/TELEMETRY/TELEMETRY_Missing_lines.png...
Creating image: ./RESULTS/DAILY/090406/TELEMETRY/TELEMETRY_Gaps.png...

TELEMETRY ANALYSIS completed

#####

BROWSE PRODUCTS ANALYSIS

#####

Analysis will be performed on 2009-04-06

Scanning directory /nas3/ENVISAT/ASAR//ASA_GM_BP...
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_GM_BP/JPG/20090406/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDK20090406_171511_000001022077_00499_37126_3460.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDK20090406_171830_000001812077_00499_37126_3462.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDK20090406_173112_000003622077_00499_37126_3464.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDK20090406_180621_000008882077_00499_37126_3474.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDK20090406_184216_000002352077_00500_37127_3472.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDK20090406_185110_000002412077_00500_37127_3476.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDK20090406_190441_000002832077_00500_37127_3579.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDK20090406_194541_000001812077_00500_37127_3581.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_GM_BP/ASA_GM_BPZPDK20090406_195222_000005612077_00500_37127_3586.N1 ...

ANALYSIS COMPLETED: 9 GM browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_AP_BP...
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_AP_BP/JPG/20090406/

ANALYSIS COMPLETED: 0 AP browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_IM_BP...



Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_IM_BP/JPG/20090406/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDK20090406_185509_00000362077_00500_37127_3481.N1 ...
Stripping browse product /nas3/ENVISAT/ASAR//ASA_IM_BP/ASA_IM_BPZPDK20090406_203043_00000162077_00501_37128_3577.N1 ...

ANALYSIS COMPLETED: 2 IM browse products to see...

Scanning directory /nas3/ENVISAT/ASAR//ASA_WS_BP...
Results will be exported to the directory: /nas3/ENVISAT/ASAR//ASA_WS_BP/JPG/20090406/

Stripping browse product /nas3/ENVISAT/ASAR//ASA_WS_BP/ASA_WS_BPZPDK20090406_185621_000004902077_00500_37127_3575.N1 ...

ANALYSIS COMPLETED: 1 WS browse products to see...

BROWSE PRODUCTS ANALYSIS completed
#####

HTML REPORT generation
#####

Building file ./RESULTS/DAILY/090406/asarReport.html...
Building DATA SUMMARY section...
Building AUXILIARY FILES ANALYSIS section...
Building MODULE STEPPING ANALYSIS section...
Building CALIBRATION PULSES ANALYSIS section...
Building DOPPLER ANALYSIS section...
Building CHIRP ANALYSIS section...
Building RAW DATA ANALYSIS section...
Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed
#####



ASAR Daily Report



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20090406_031648_000000562077_00490_37117_3800.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20090406_002916_000002652077_00489_37116_3518.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_003618_000002532077_00489_37116_3523.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_010603_000003562077_00489_37116_3525.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_012442_000006282077_00489_37116_3533.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_014357_000006042077_00489_37116_3661.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_020439_000005072077_00490_37117_3663.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_021610_000002412077_00490_37117_3665.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_022852_000001322077_00490_37117_3667.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_023151_000002652077_00490_37117_3675.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_025941_000004532077_00490_37117_3842.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_031252_00000782077_00490_37117_3840.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_031852_000002472077_00490_37117_3838.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_032305_000001322077_00490_37117_3836.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_032755_000003262077_00490_37117_3824.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_033530_000000962077_00491_37118_3813.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_034104_000009302077_00491_37118_3829.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_034104_000017452077_00491_37118_3941.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_041625_000001322077_00491_37118_3808.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_044017_000009302077_00491_37118_3991.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_052000_000001692077_00492_37119_3993.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_053017_000006222077_00492_37119_4009.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_054624_000001202077_00492_37119_3995.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_055239_000003502077_00492_37119_4017.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_203551_000001322077_00501_37128_4491.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_204717_00000902077_00501_37128_4493.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20090406_212617_000009302077_00501_37128_4498.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_062053_000004162077_00492_37119_2605.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_062926_000004532077_00492_37119_2610.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_071036_000001322077_00493_37120_2612.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_071544_000002772077_00493_37120_2633.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_091615_000000722077_00494_37121_2771.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_094547_000007372077_00494_37121_2776.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_103743_000002592077_00495_37122_2785.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_104429_000001812077_00495_37122_2955.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_112241_000009302077_00495_37122_2965.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_121234_000001752077_00496_37123_2963.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_122012_000001442077_00496_37123_2967.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_124926_000003682077_00496_37123_3082.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_125541_000001082077_00496_37123_3084.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_130434_000008822077_00496_37123_3092.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_132506_000004712077_00496_37123_3097.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_134852_000007852077_00497_37124_3103.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_140445_00000902077_00497_37124_3208.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_141029_000001142077_00497_37124_3210.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_142345_000002892077_00497_37124_3215.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_143001_00000962077_00497_37124_3217.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_144353_000009302077_00497_37124_3222.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_151933_000002532077_00498_37125_3224.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_152816_000002772077_00498_37125_3226.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_154724_000003742077_00498_37125_3336.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_155521_000002412077_00498_37125_3338.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_160123_000001202077_00498_37125_3343.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_162429_000005552077_00498_37125_3345.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_163902_00000902077_00498_37125_3350.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_165940_000010032077_00499_37126_3430.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_171511_000001022077_00499_37126_3459.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_171830_000001812077_00499_37126_3461.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_173112_000003622077_00499_37126_3463.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_180621_000008882077_00499_37126_3473.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_184216_000002352077_00500_37127_3471.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_185110_000002412077_00500_37127_3475.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_190441_000002832077_00500_37127_3578.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_194541_000001812077_00500_37127_3580.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20090406_195222_000005612077_00500_37127_3585.N1					OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_IMM_1PNPDE20090406_021303_00000532077_00490_37117_3738.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_022501_00000672077_00490_37117_3771.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_023103_00000342077_00490_37117_3756.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_041009_000002422077_00491_37118_3943.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_041009_000003632077_00491_37118_3947.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_052249_000001572077_00492_37119_3975.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_054825_000001272077_00492_37119_3971.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_055106_000008822077_00492_37119_3973.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_060418_000001272077_00492_37119_4085.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_091316_00000372077_00494_37121_4200.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_091527_00000372077_00494_37121_4206.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_092313_00000532077_00494_37121_4208.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_114204_00000632077_00495_37122_4297.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_142833_00000762077_00497_37124_4365.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_152344_000002612077_00498_37125_4399.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_173711_000002152077_00499_37126_4445.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_184608_000001842077_00500_37127_4449.N1		OK	OK	OK
ASA_IMM_1PNPDE20090406_184952_00000672077_00500_37127_4429.N1		OK	OK	OK
ASA_IMM_1PNPDK20090406_091053_00000402077_00494_37121_2753.N1		OK	OK	OK
ASA_IMM_1PNPDK20090406_134425_000008822077_00497_37124_3191.N1		OK	OK	OK
ASA_IMM_1PNPDK20090406_153913_000001142077_00498_37125_3318.N1		OK	OK	OK
ASA_IMM_1PNPDK20090406_185509_00000362077_00500_37127_3480.N1		OK	OK	OK
ASA_IMM_1PNPDK20090406_203043_00000162077_00501_37128_3576.N1		OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WSM_1PNPDE20090406_002737_000000972077_00489_37116_3654.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_003343_000001522077_00489_37116_3656.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_004037_000001902077_00489_37116_3744.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_004037_000004152077_00489_37116_3851.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_004448_000000612077_00489_37116_3648.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_004650_000000422077_00489_37116_3652.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_012014_000002502077_00489_37116_3762.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_021419_000001092077_00490_37117_3783.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_022013_000001342077_00490_37117_3798.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_022013_000002692077_00490_37117_3916.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_022322_000000612077_00490_37117_3779.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_022655_000001162077_00490_37117_3796.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_023620_000002692077_00490_37117_3785.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_030718_000000732077_00490_37117_3856.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_030718_000003302077_00490_37117_4101.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_031027_000001412077_00490_37117_3945.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_031416_000001532077_00490_37117_3939.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_052606_000001892077_00492_37119_4116.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_052606_000002442077_00492_37119_4180.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_060740_000002252077_00492_37119_4118.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_091950_000001902077_00494_37121_4229.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_094313_000001532077_00494_37121_4286.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_102931_000000732077_00495_37122_4268.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_102931_000004902077_00495_37122_4326.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_103146_000001762077_00495_37122_4300.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_103544_000000612077_00495_37122_4280.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_105730_000002992077_00495_37122_4284.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_120826_000002452077_00496_37123_4324.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_121534_000000732077_00496_37123_4312.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_121534_000001762077_00496_37123_4347.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_121748_000000422077_00496_37123_4316.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_124552_000000732077_00496_37123_4302.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_124752_000000912077_00496_37123_4319.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_140802_000001352077_00497_37124_4405.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_140916_000000612077_00497_37124_4363.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_153255_000001532077_00498_37125_4355.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_154533_000001102077_00498_37125_4403.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_155344_000000912077_00498_37125_4397.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_163351_000003062077_00498_37125_4401.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_172436_000001352077_00499_37126_4451.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_172436_000003912077_00499_37126_4475.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_172847_000001392077_00499_37126_4452.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_183354_000000912077_00499_37126_4447.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_195002_000000612077_00500_37127_4471.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_200810_000001532077_00500_37127_4483.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20090406_201120_000001902077_00500_37127_4485.N1					OK	OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20090406_004836_000010092077_00489_37116_3528.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_011202_000003752077_00489_37116_3531.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_013510_000002402077_00489_37116_3536.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_013825_000002852077_00489_37116_3659.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_015403_000005992077_00490_37117_3670.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_024049_000009742077_00490_37117_3673.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_025649_000001352077_00490_37117_3834.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_032520_000001042077_00490_37117_3827.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_033320_000000892077_00491_37118_3816.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_033710_000001942077_00491_37118_3811.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_041843_000008992077_00491_37118_3854.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_043328_000001502077_00491_37118_3989.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_043801_000000902077_00491_37118_3986.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_045622_000013792077_00491_37118_4020.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_055831_000003142077_00492_37119_4015.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_061128_000001952077_00492_37119_4012.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20090406_214221_000001952077_00501_37128_4496.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_061428_000003452077_00492_37119_2608.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_063658_000019792077_00492_37119_2642.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_092410_000010342077_00494_37121_2774.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_095810_000018442077_00494_37121_2848.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_104735_000000902077_00495_37122_2950.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_105519_000000892077_00495_37122_2953.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_110227_000011692077_00495_37122_2958.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_113845_000001652077_00495_37122_2961.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_114313_000014692077_00495_37122_2976.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_122949_000009142077_00496_37123_3087.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_125730_000001652077_00496_37123_3090.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_131921_000003002077_00496_37123_3095.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_133258_000006452077_00496_37123_3100.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_141458_000004792077_00497_37124_3213.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_143141_000006902077_00497_37124_3220.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_145957_000011242077_00497_37124_3229.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_155922_000000742077_00498_37125_3341.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_160324_000012142077_00498_37125_3348.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_164033_000011092077_00498_37125_3357.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_174053_000014092077_00499_37126_3469.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_182527_000004642077_00499_37126_3466.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_191351_000018592077_00500_37127_3583.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_200145_000003452077_00500_37127_3588.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_214451_000001202077_00501_37128_3695.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_215359_000003742077_00501_37128_3698.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20090406_221348_000000602078_00001_37129_3701.N1					OK	OK	OK	OK


Calibration pulses for GM1 SS3 H/H

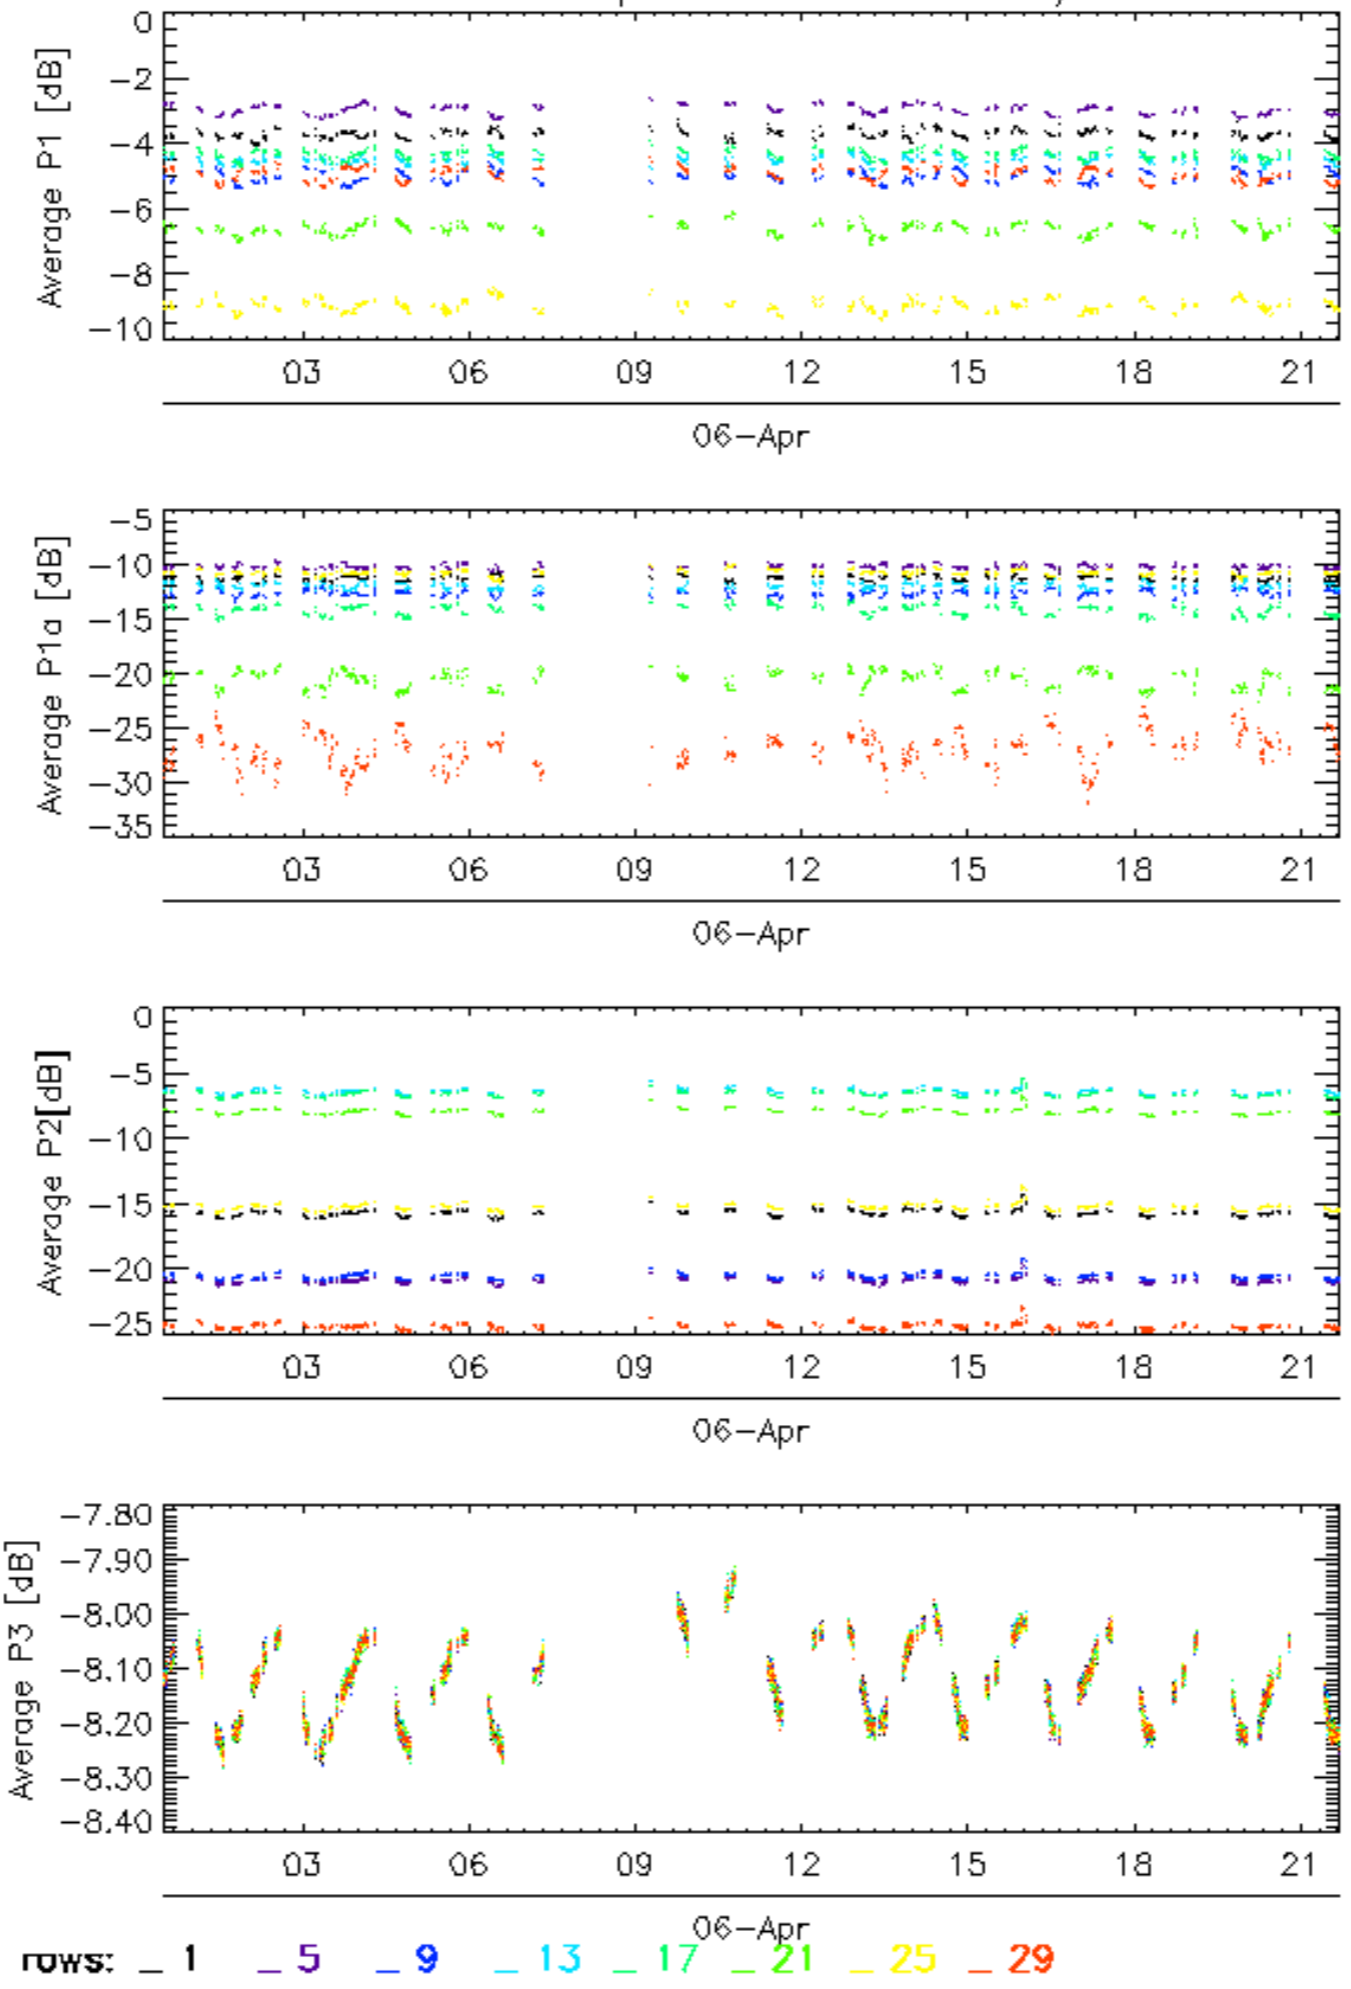


Calibration pulses for GM1 SS3 H/H

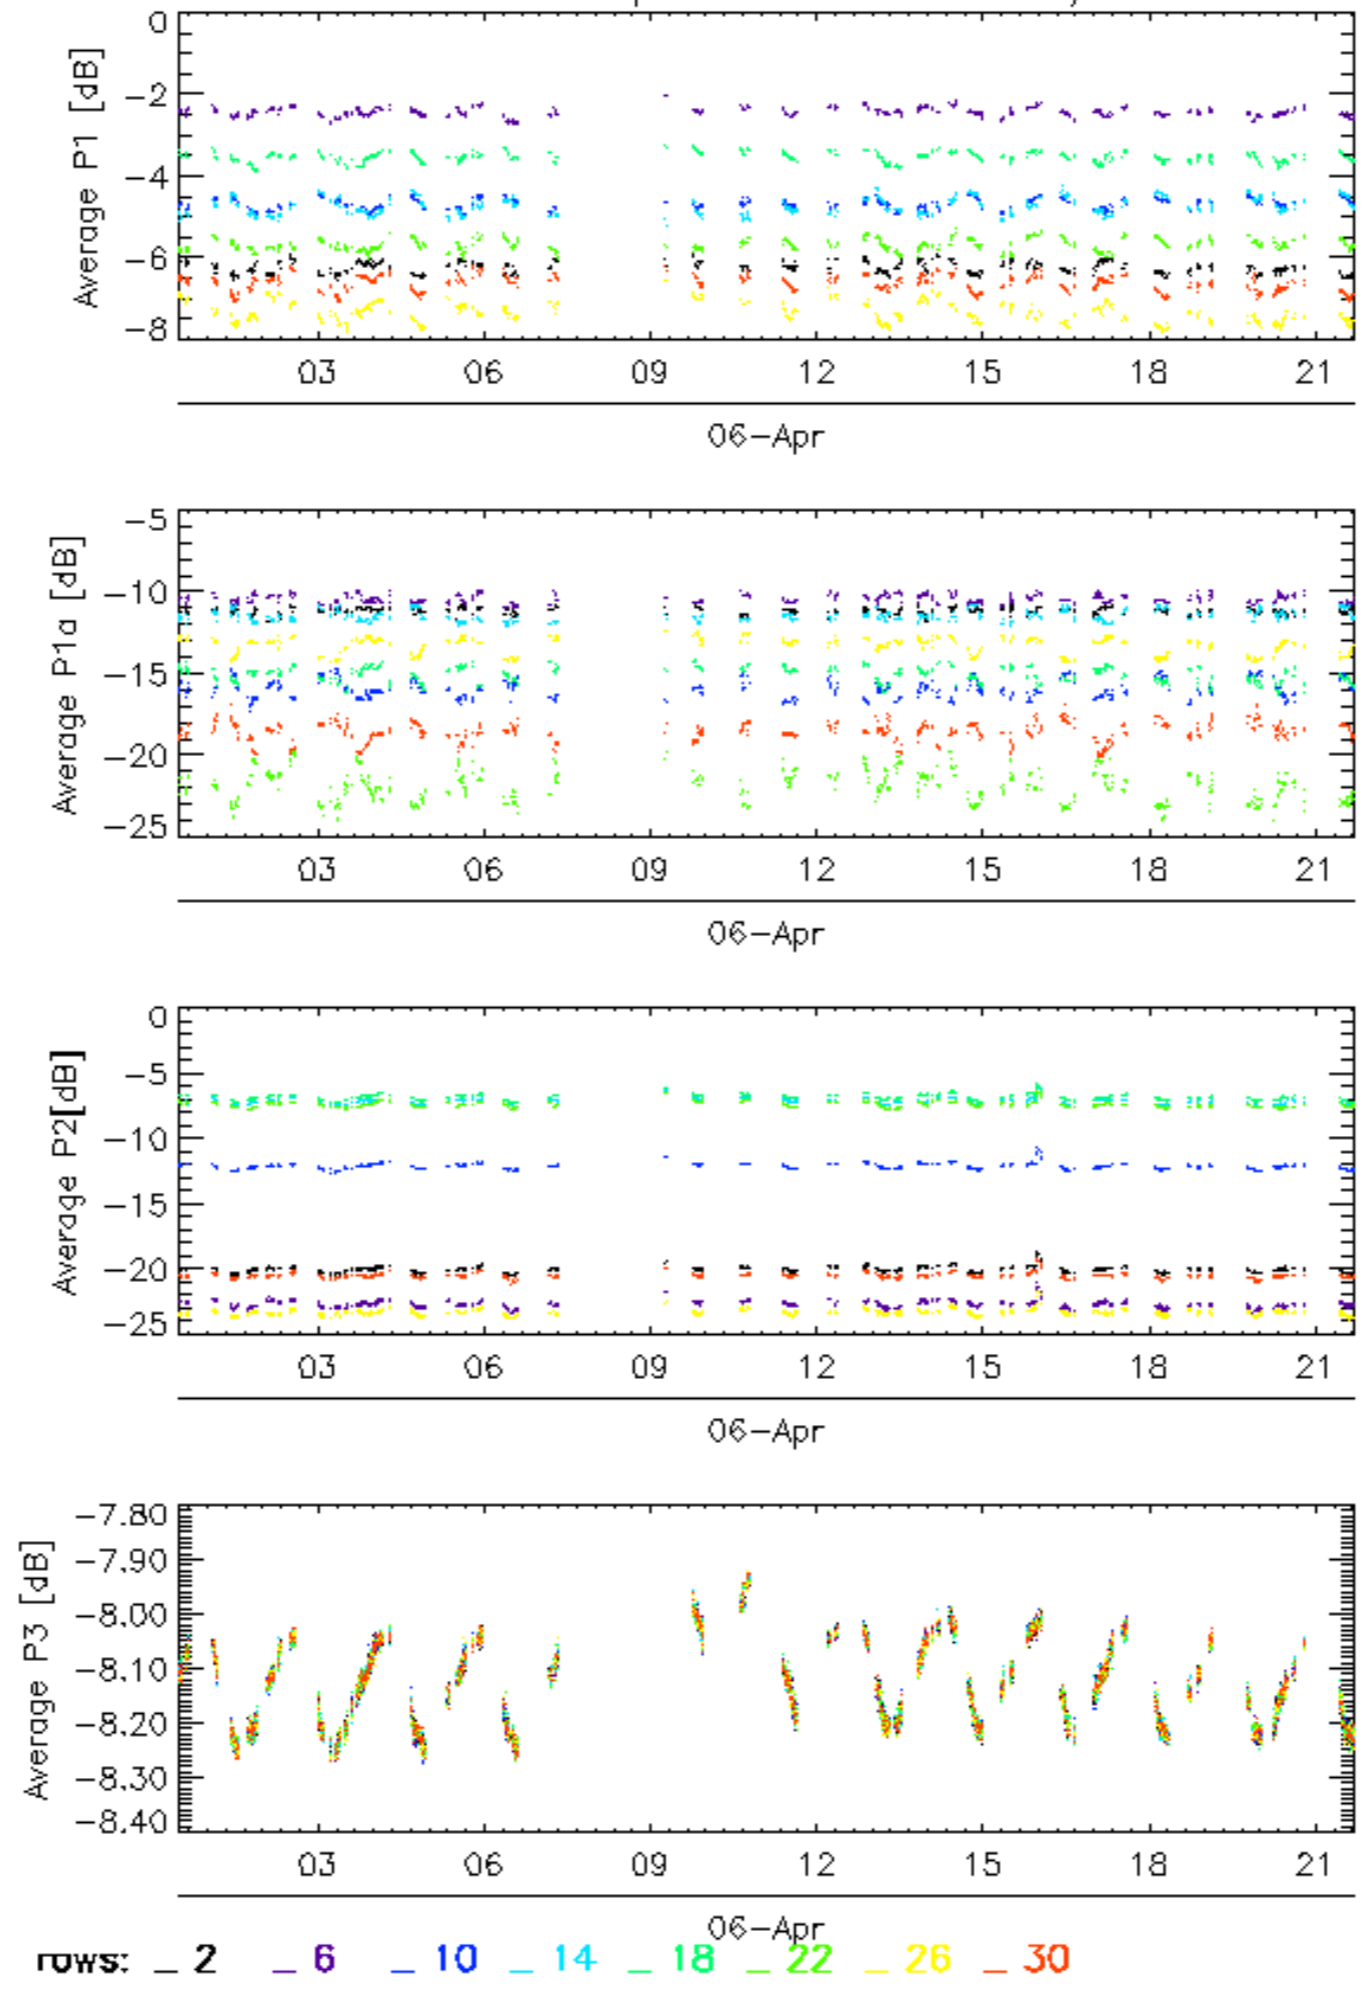


Calibration pulses for GM1 SS3 H/H

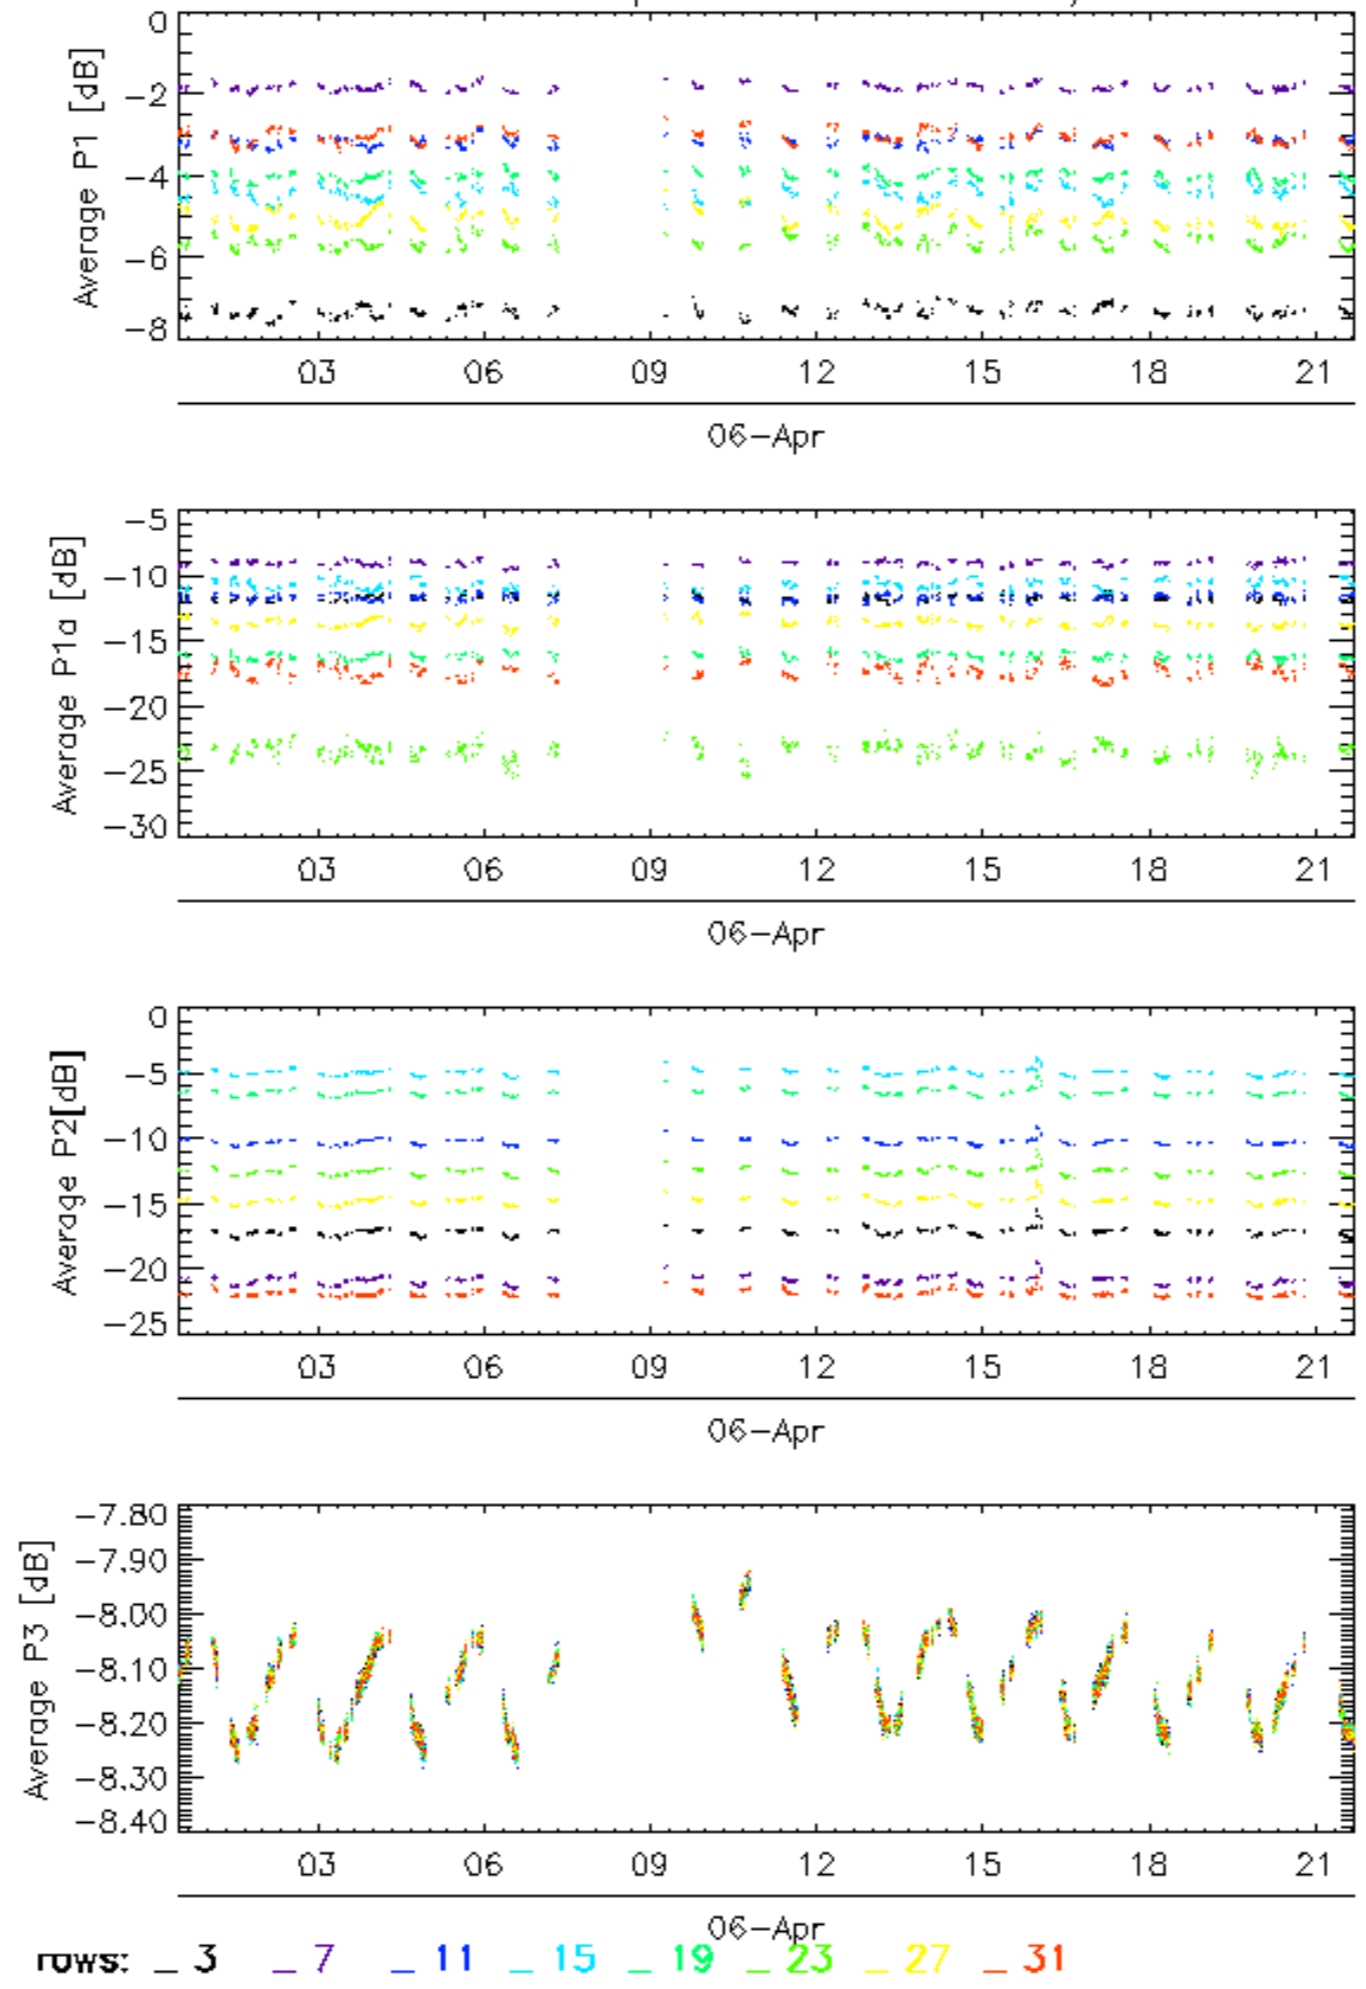


Calibration pulses for GM1 SS3 H/H

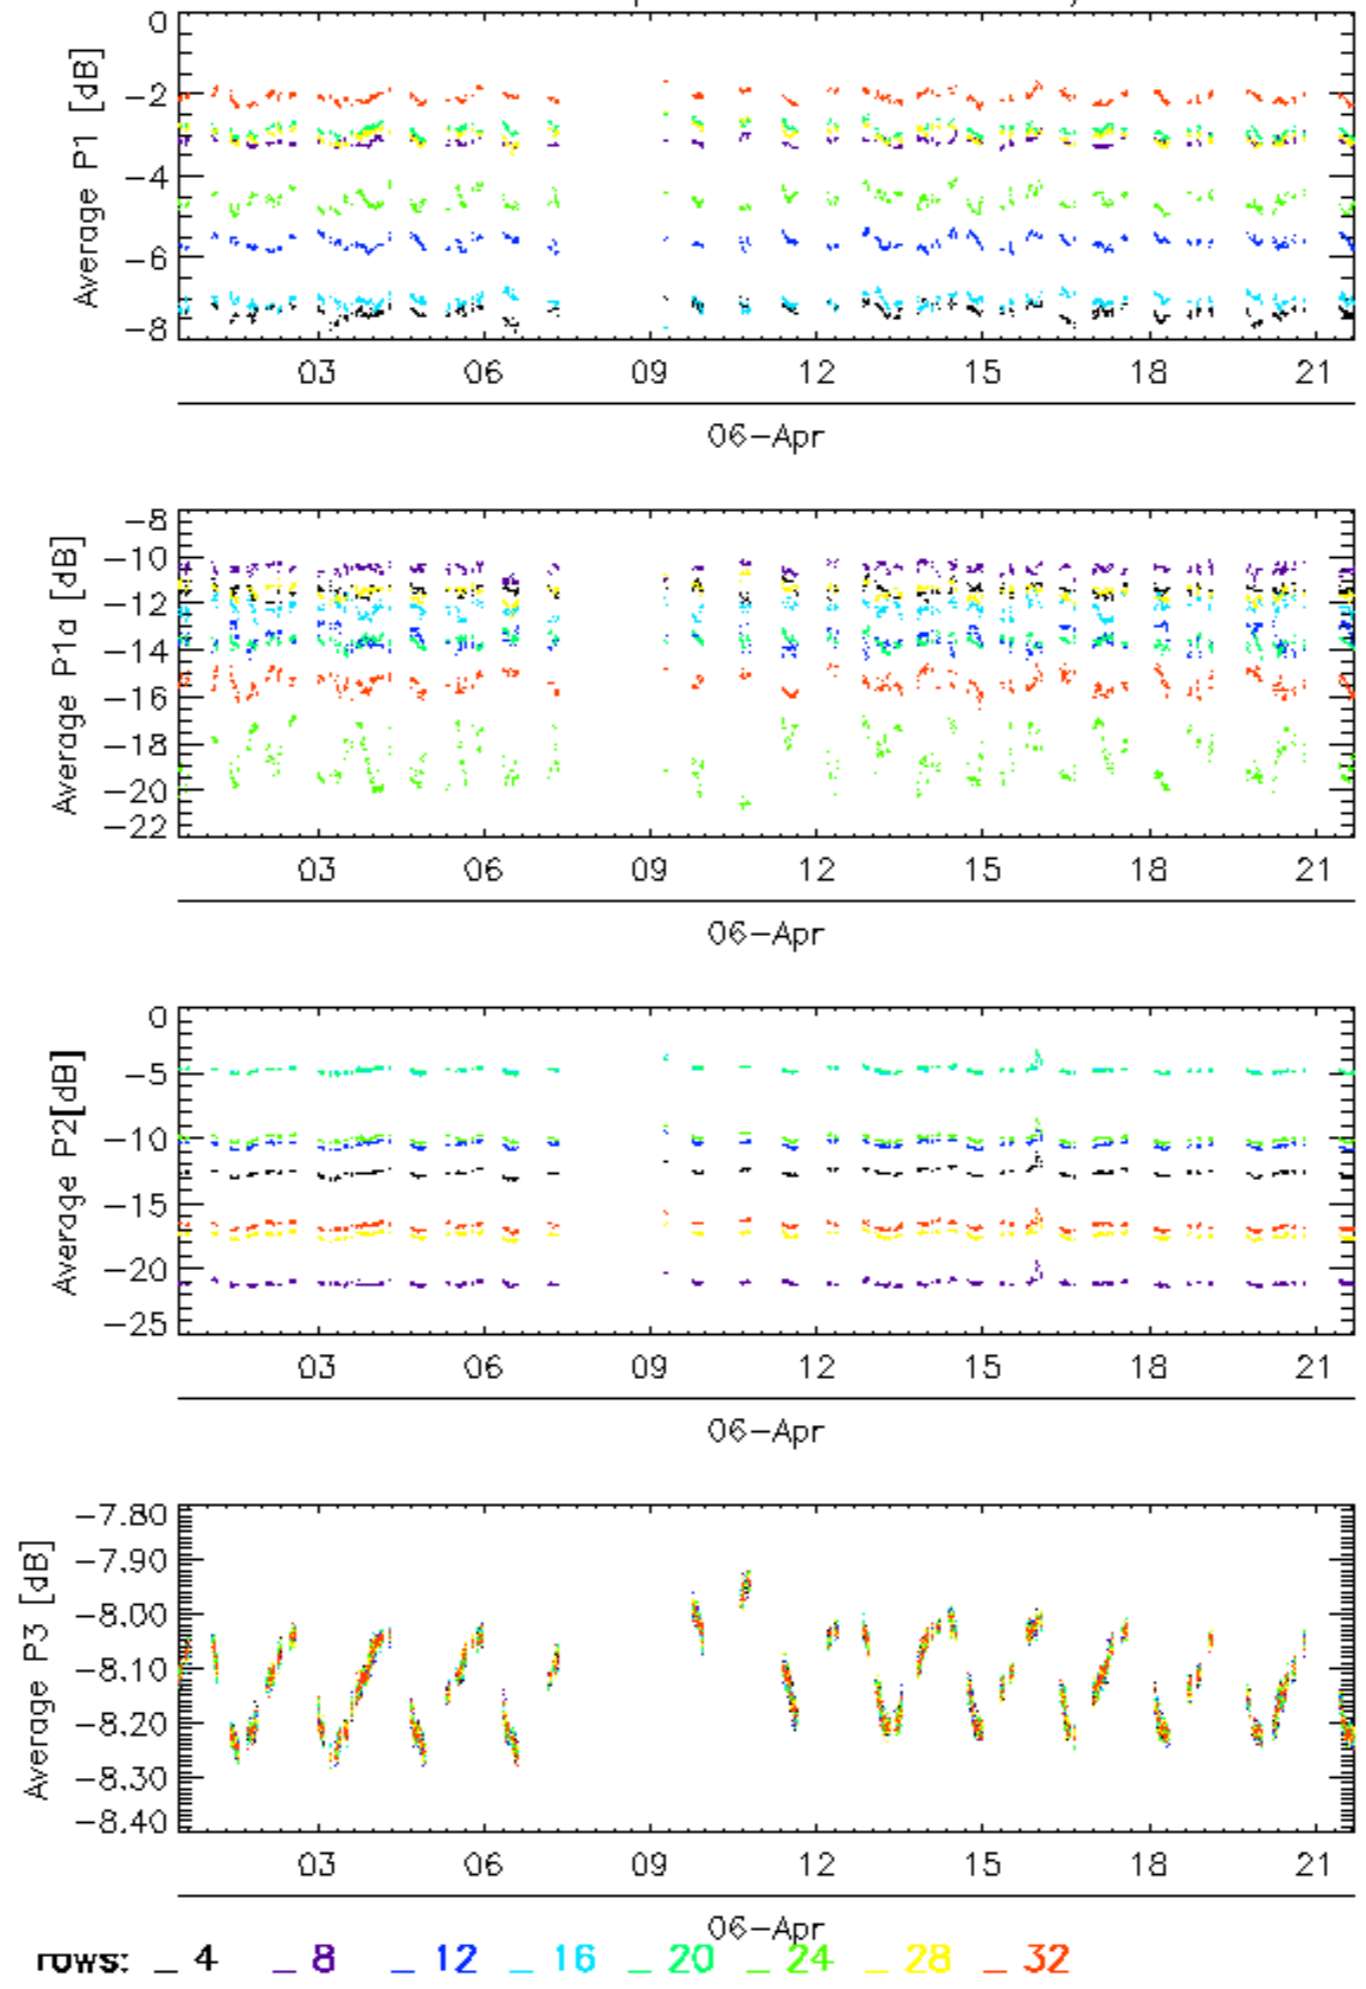


Calibration pulses for WVS IS2 V/V

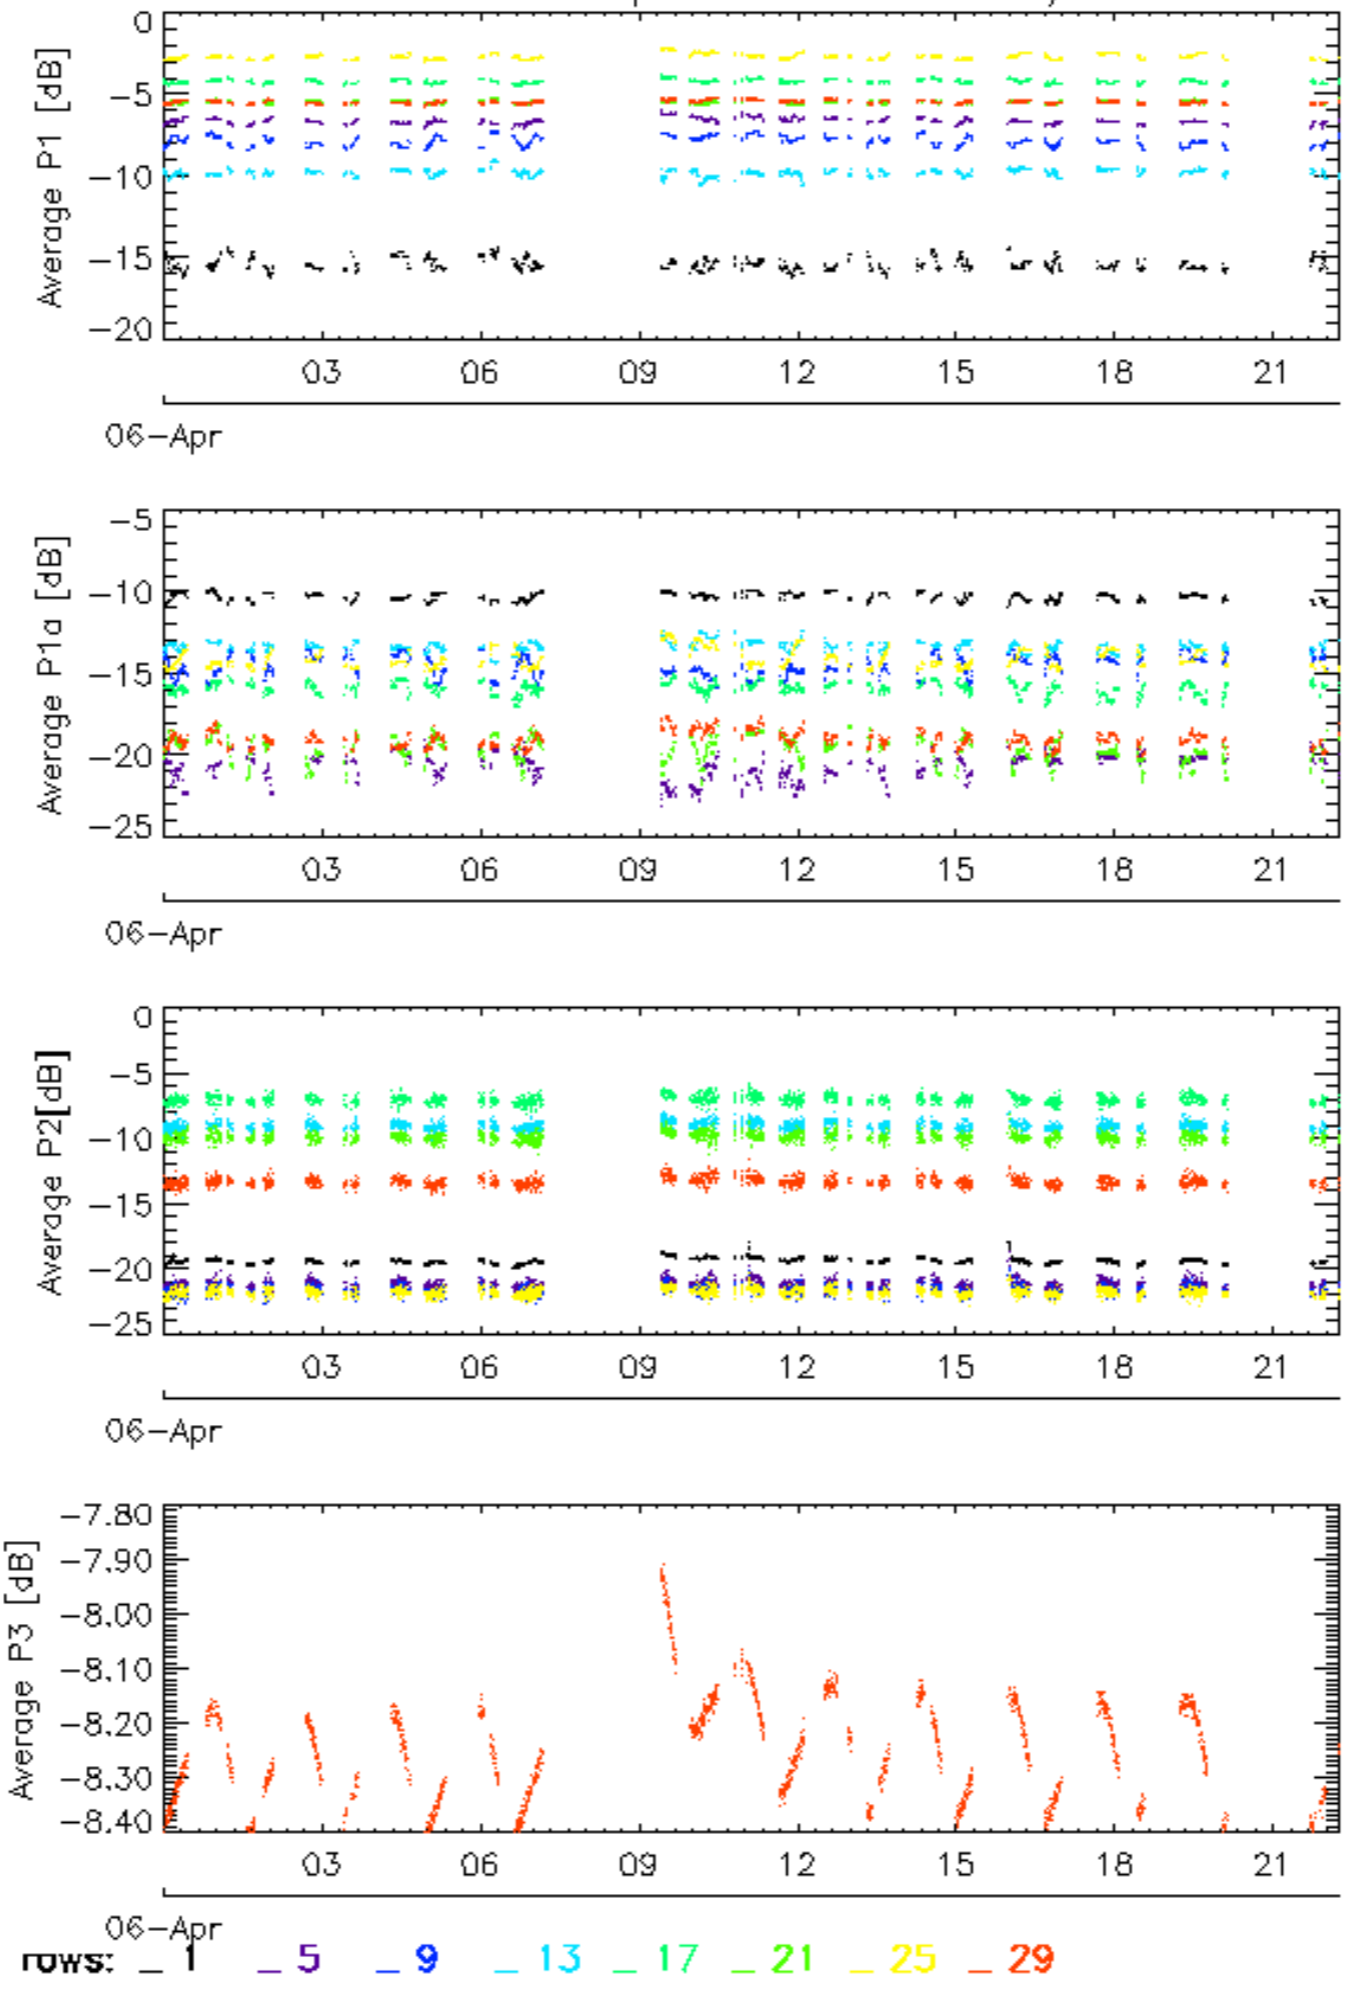


Calibration pulses for WVS IS2 V/V

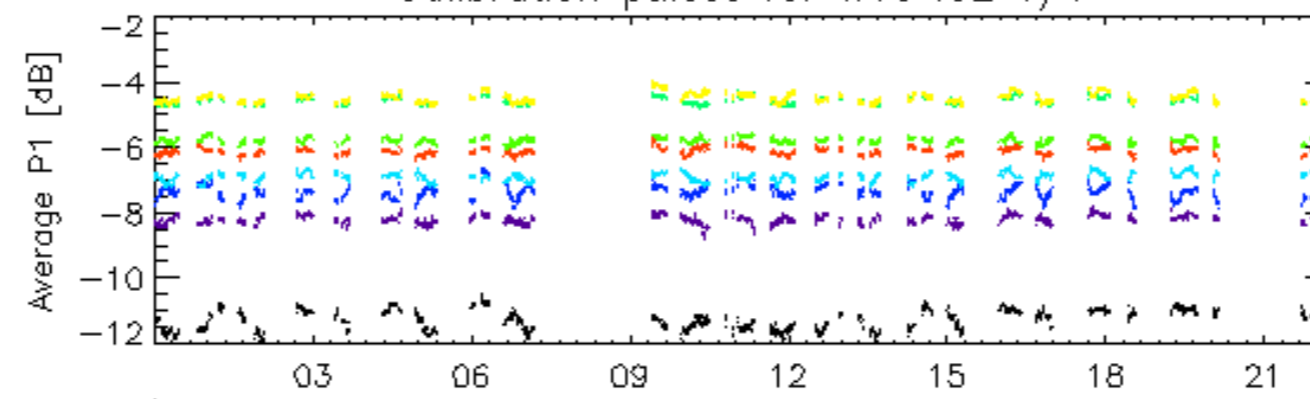


06-Apr

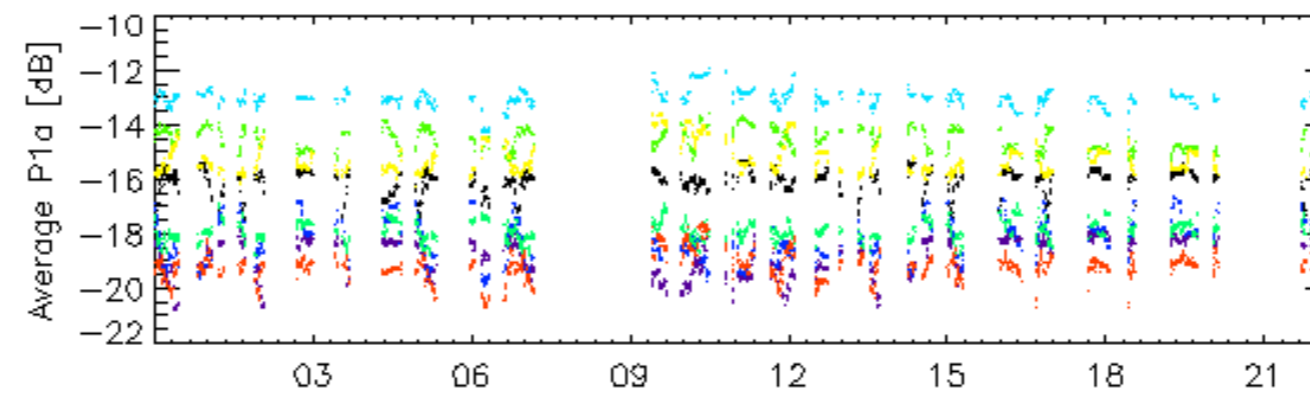

06-Apr

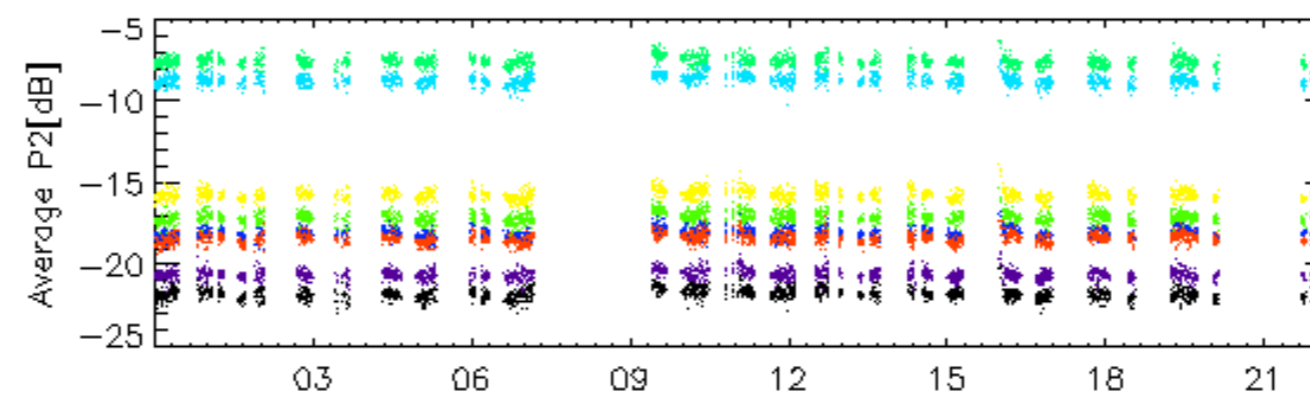


06-Apr

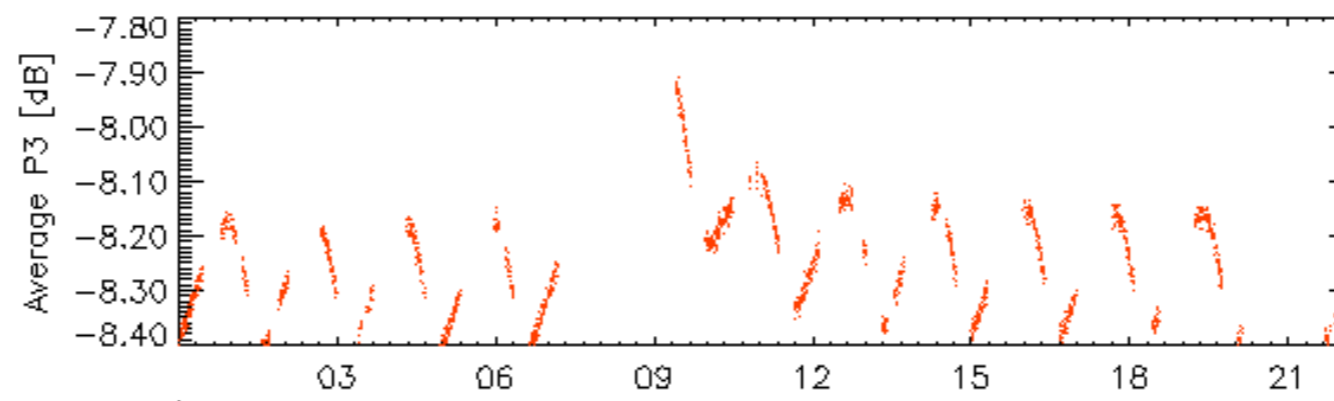


06-Apr


rows: _ 2 _ 6 _ 10 _ 14 _ 18 _ 22 _ 26 _ 30


Calibration pulses for WVS IS2 V/V


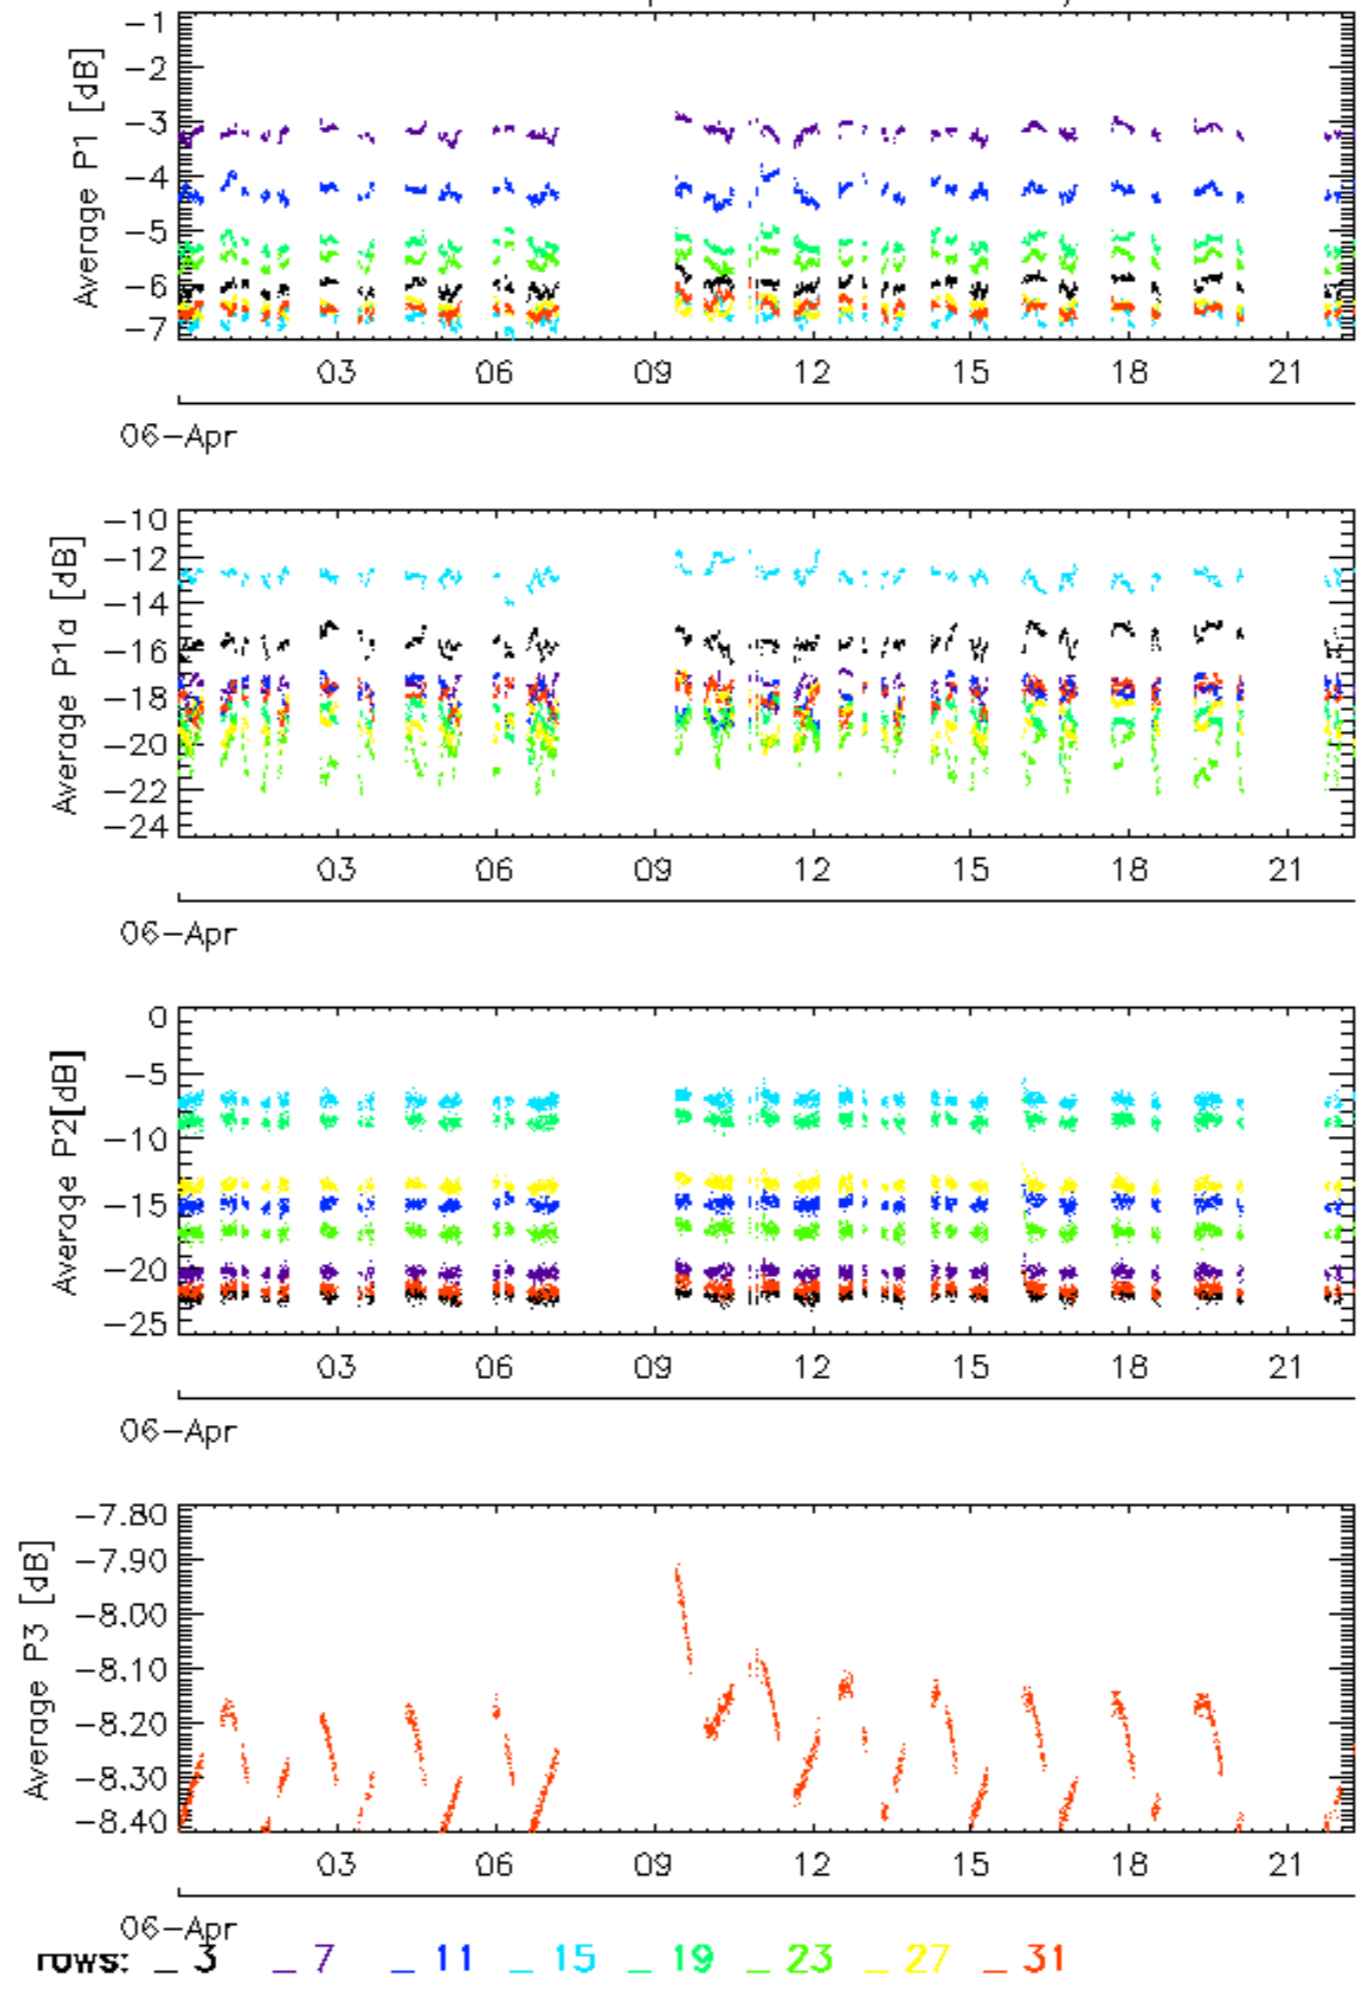




Calibration pulses for WVS IS2 V/V


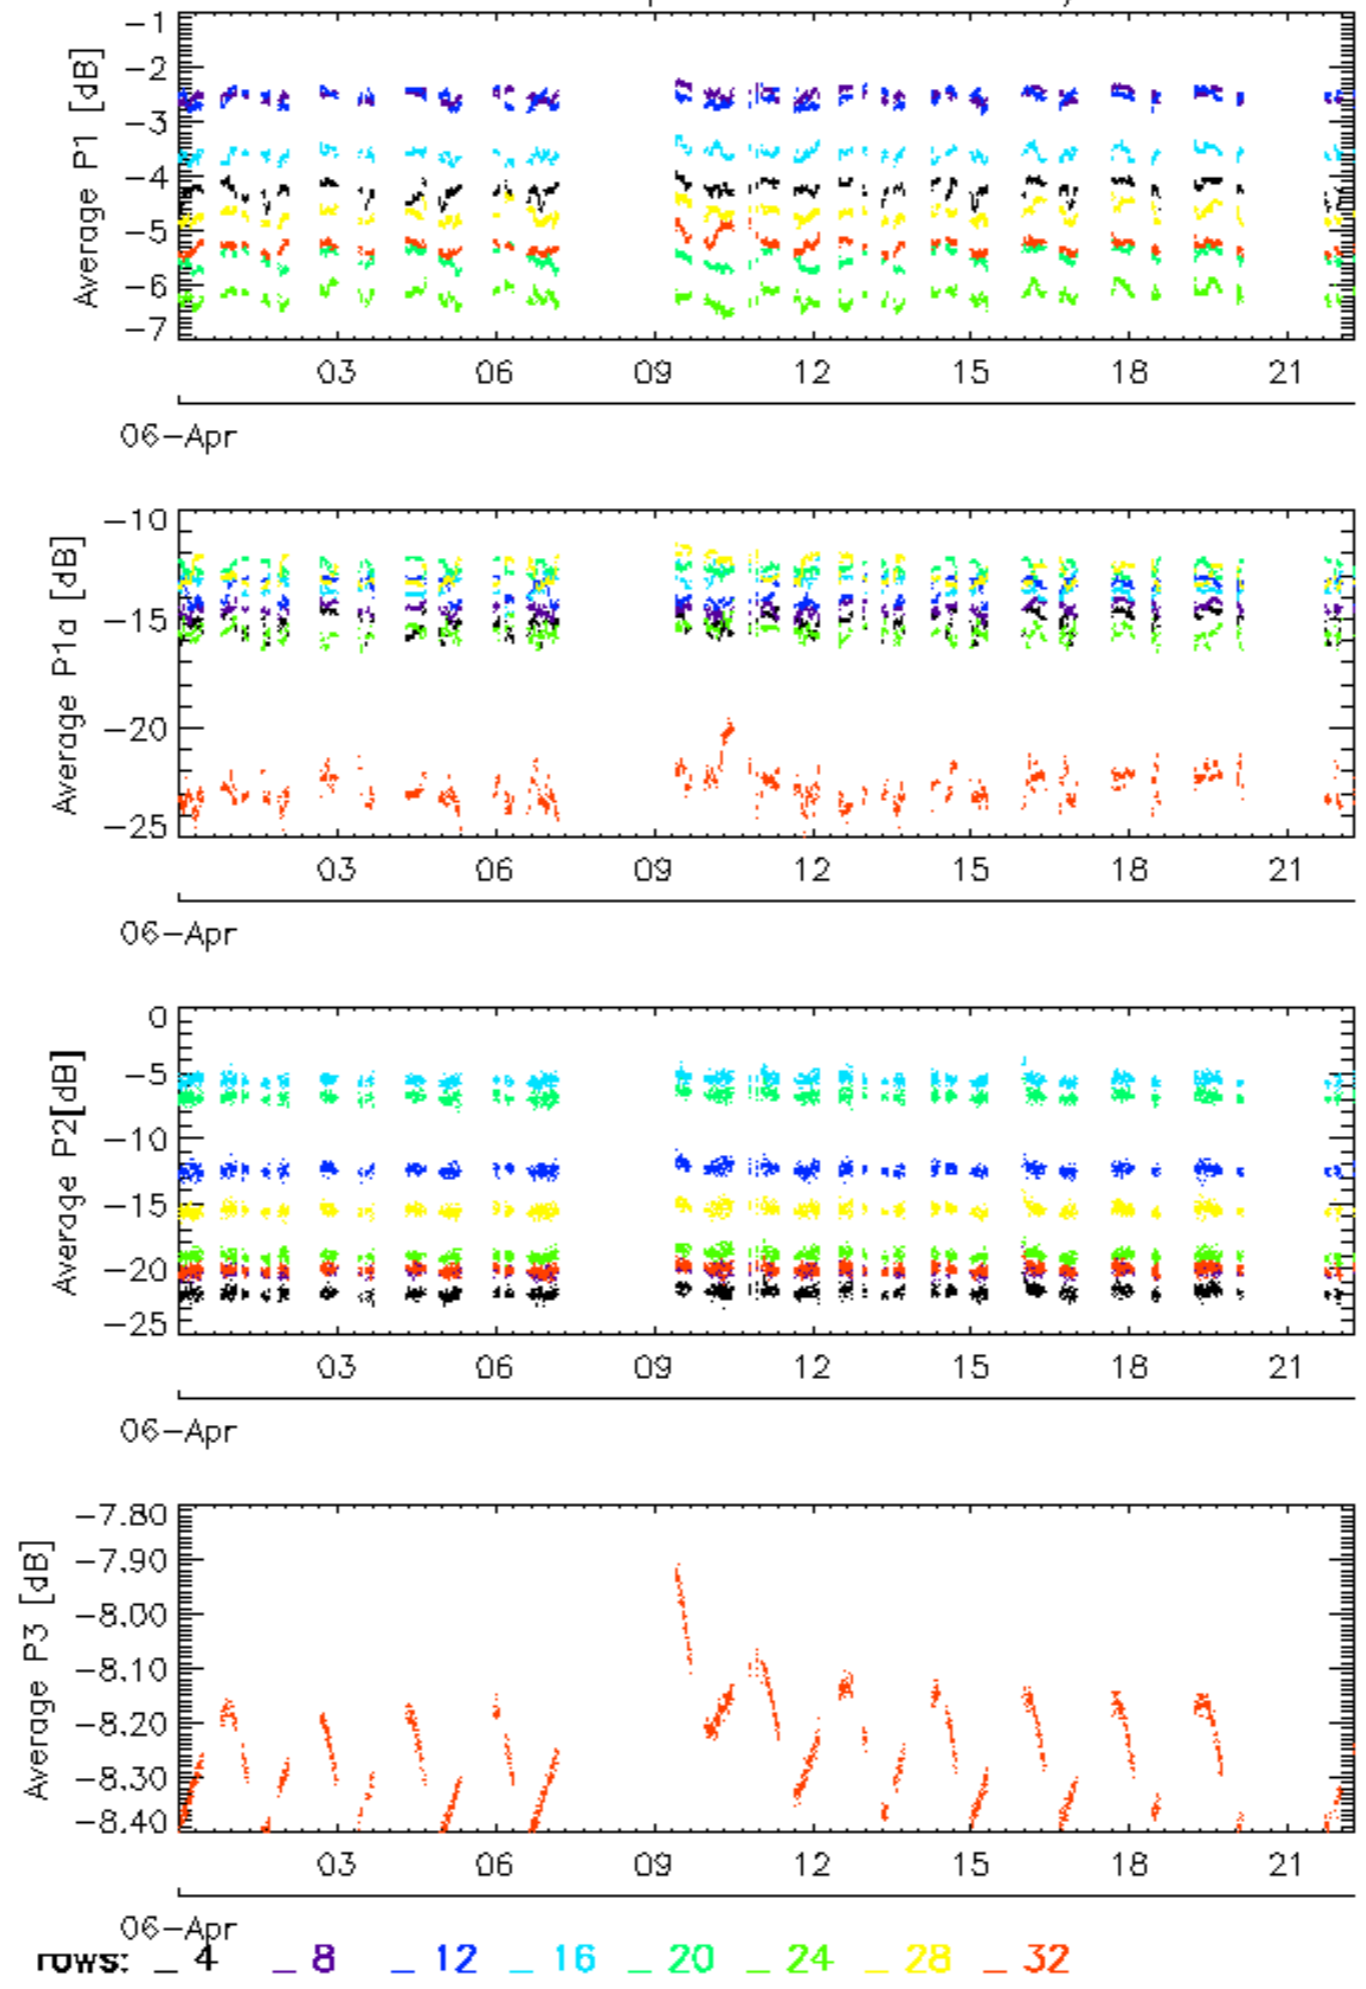



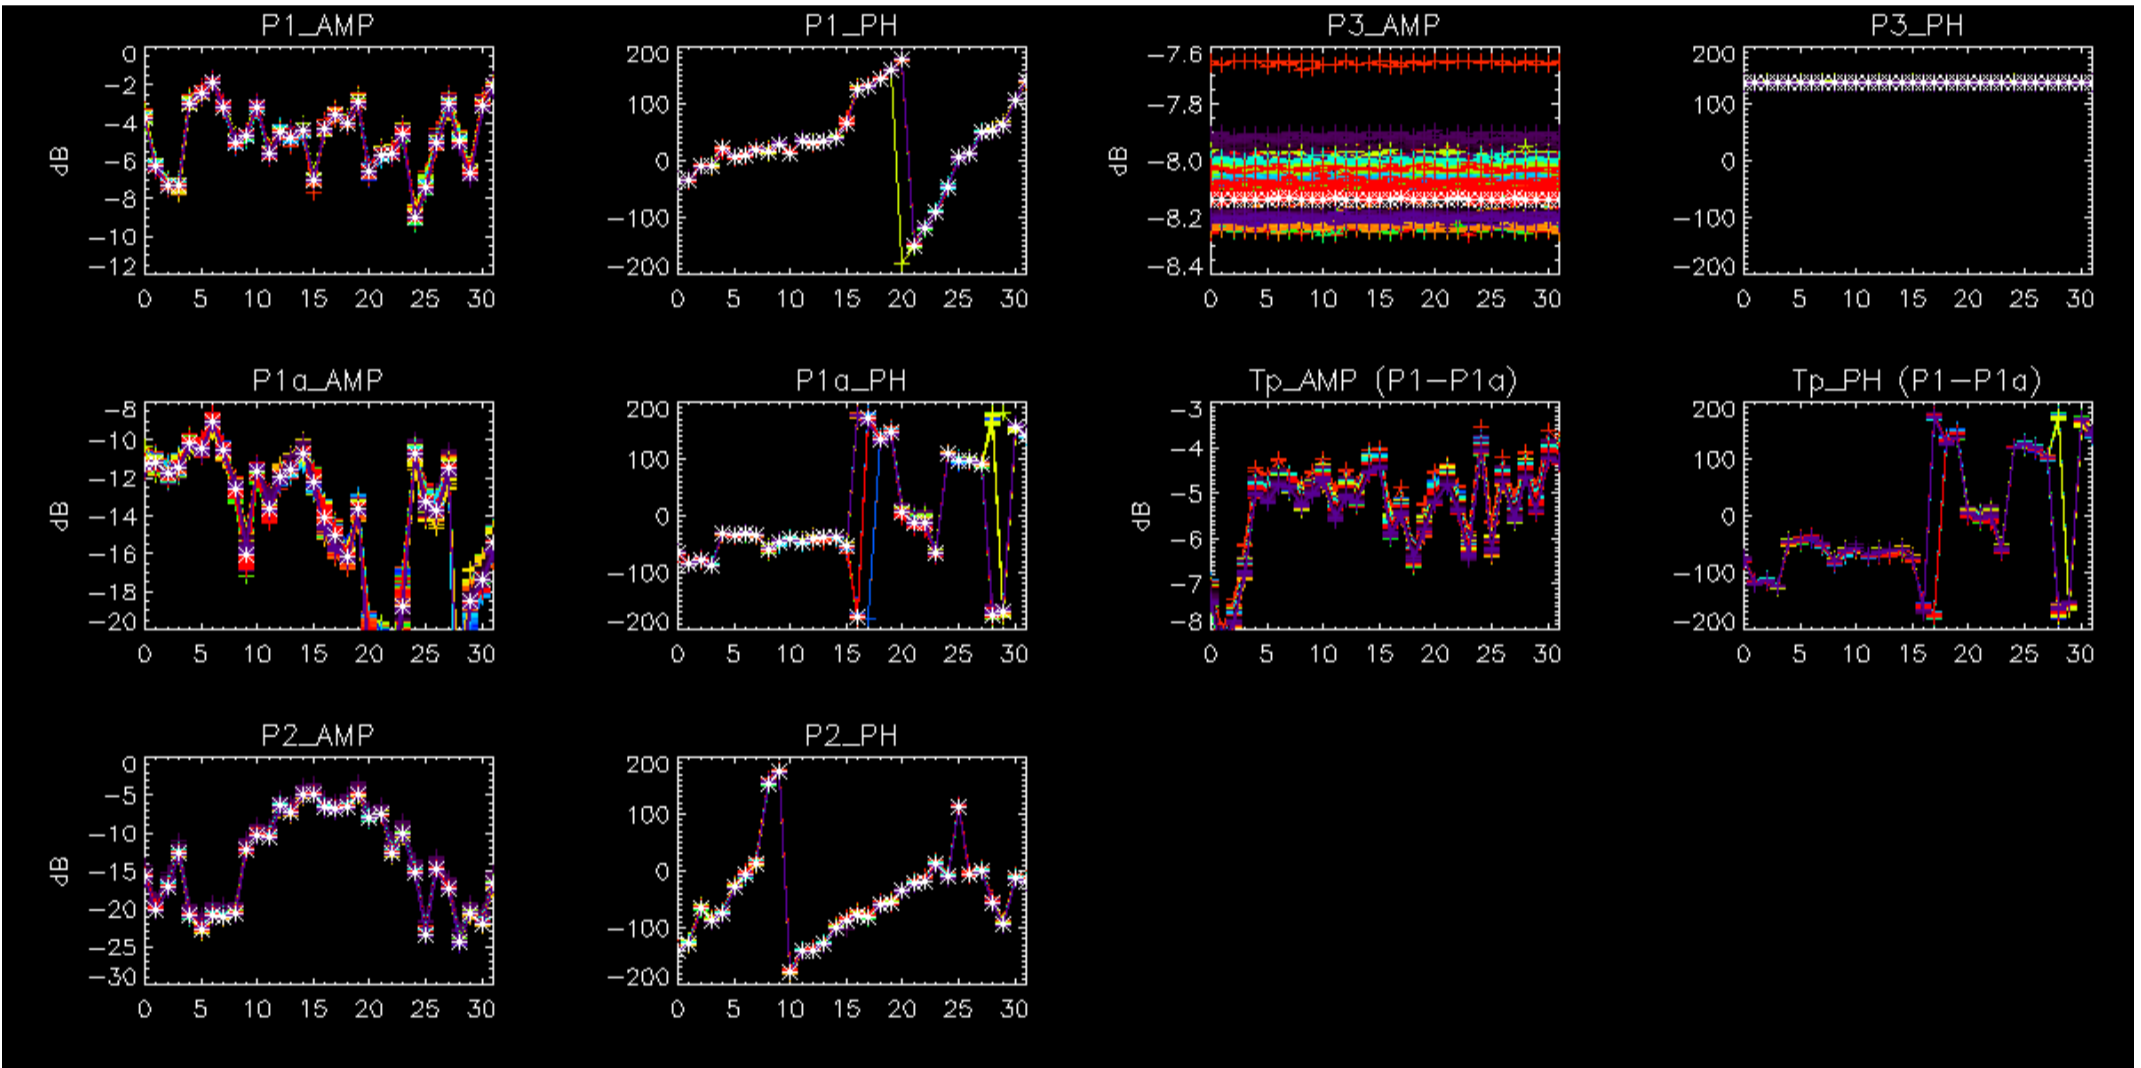



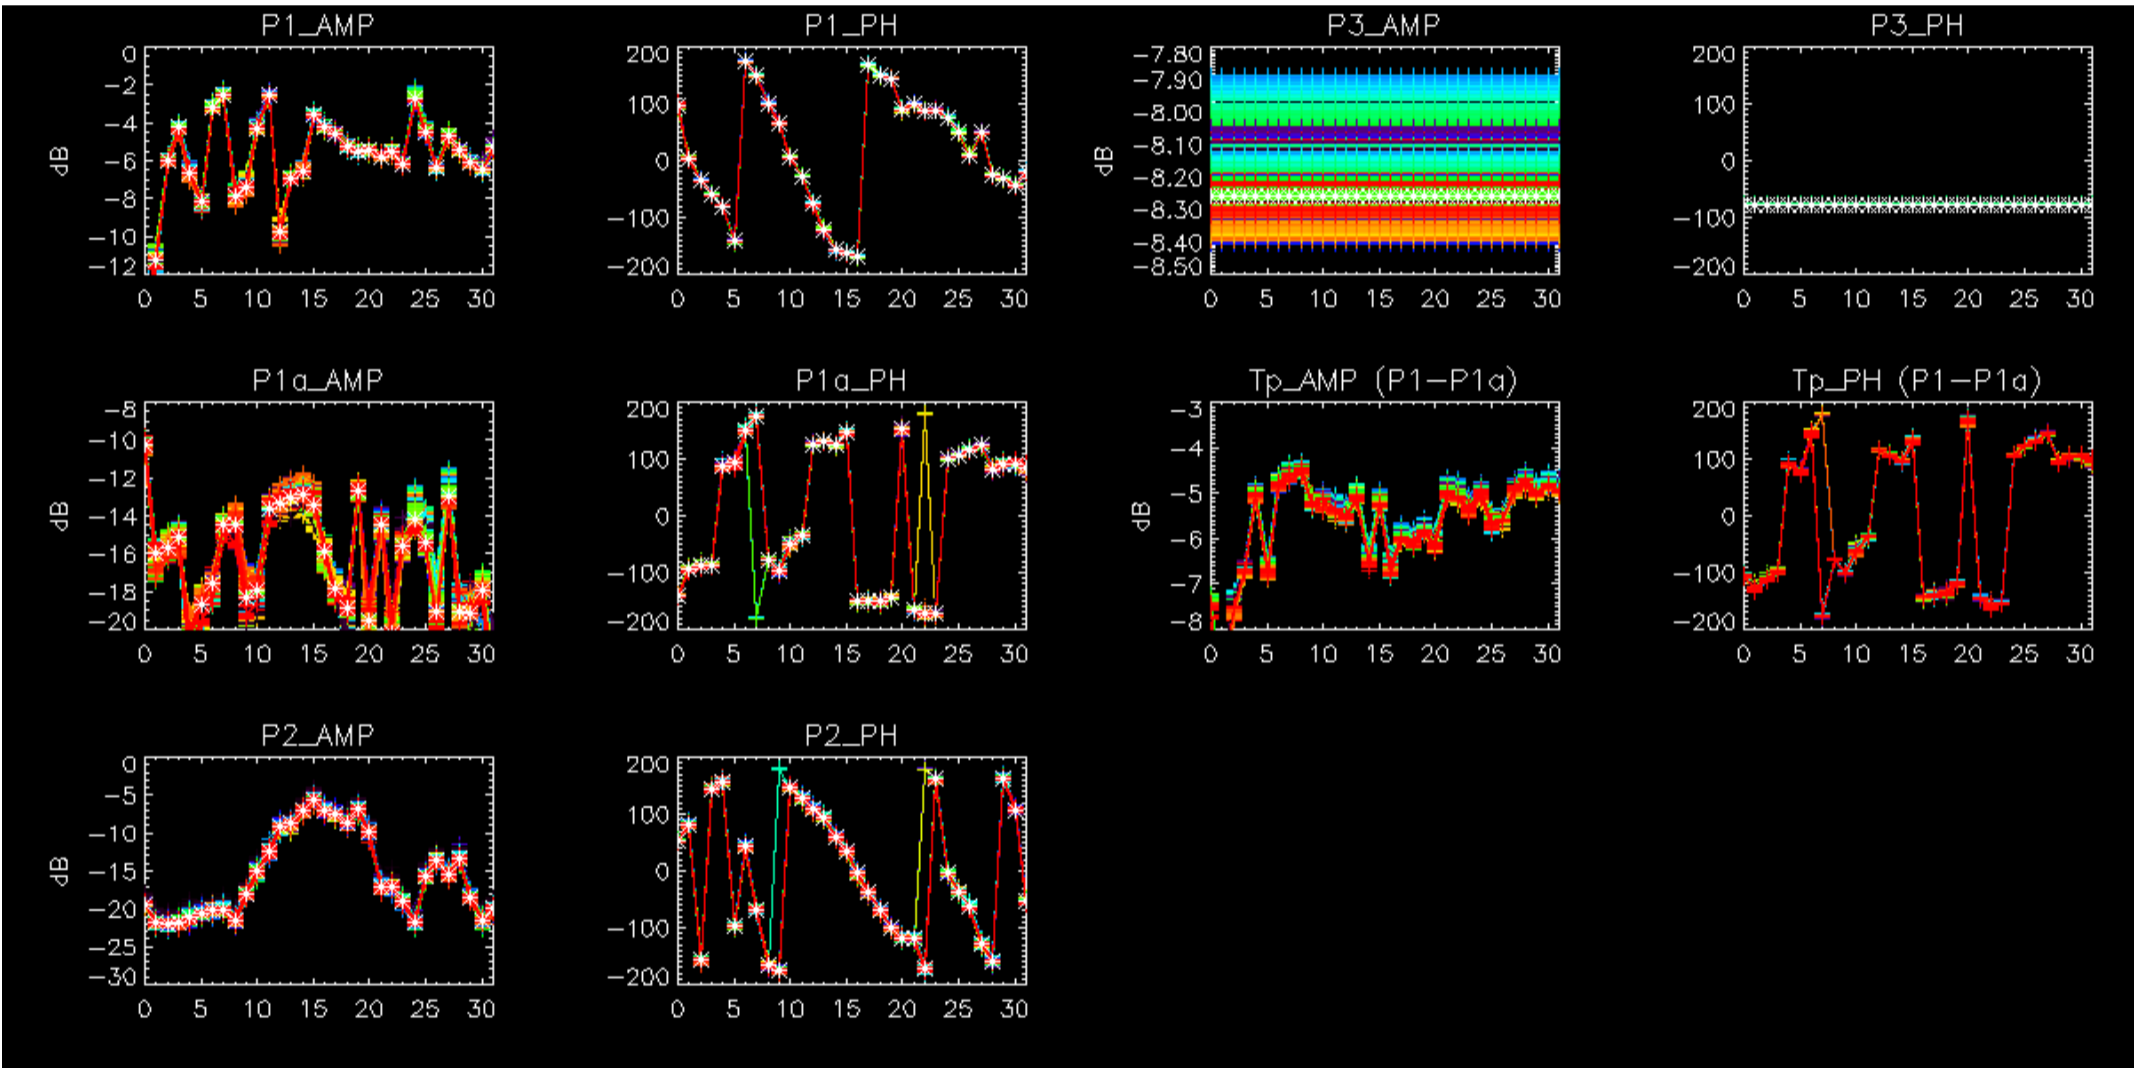


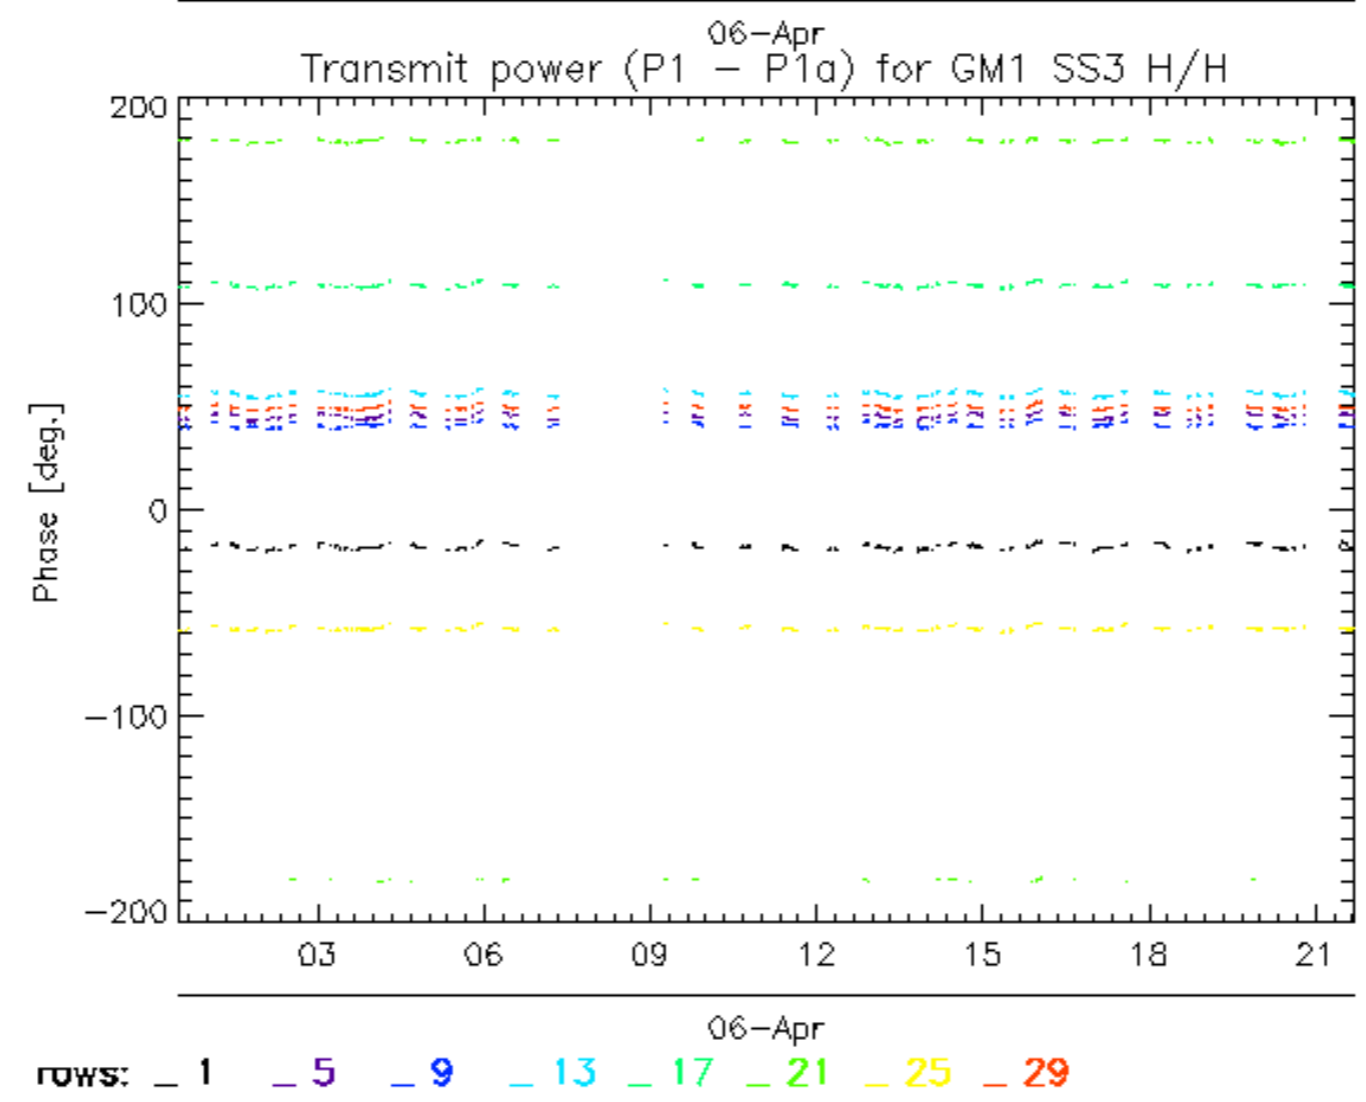
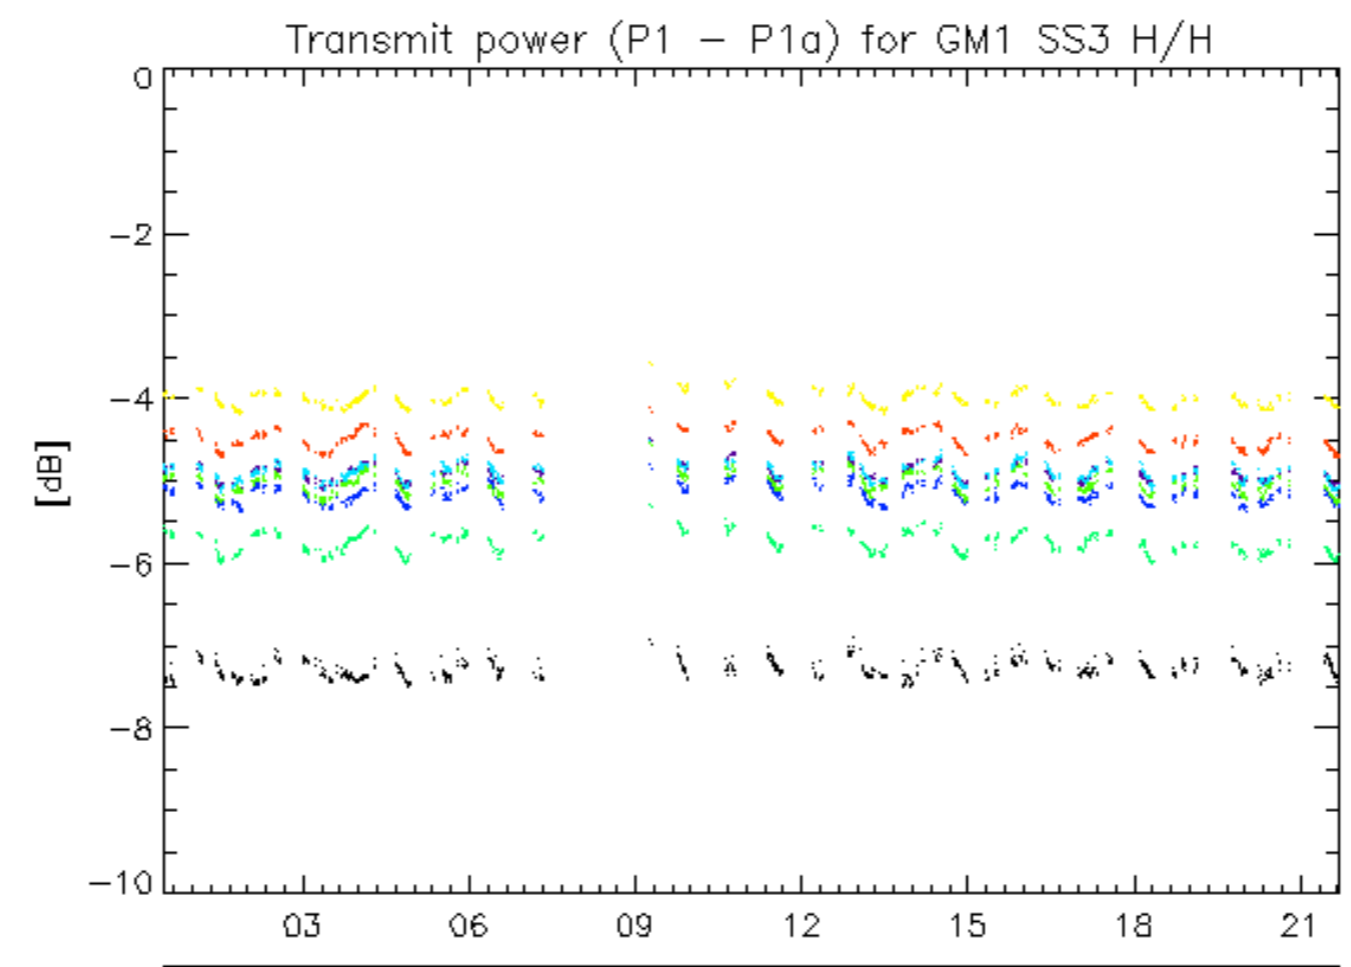


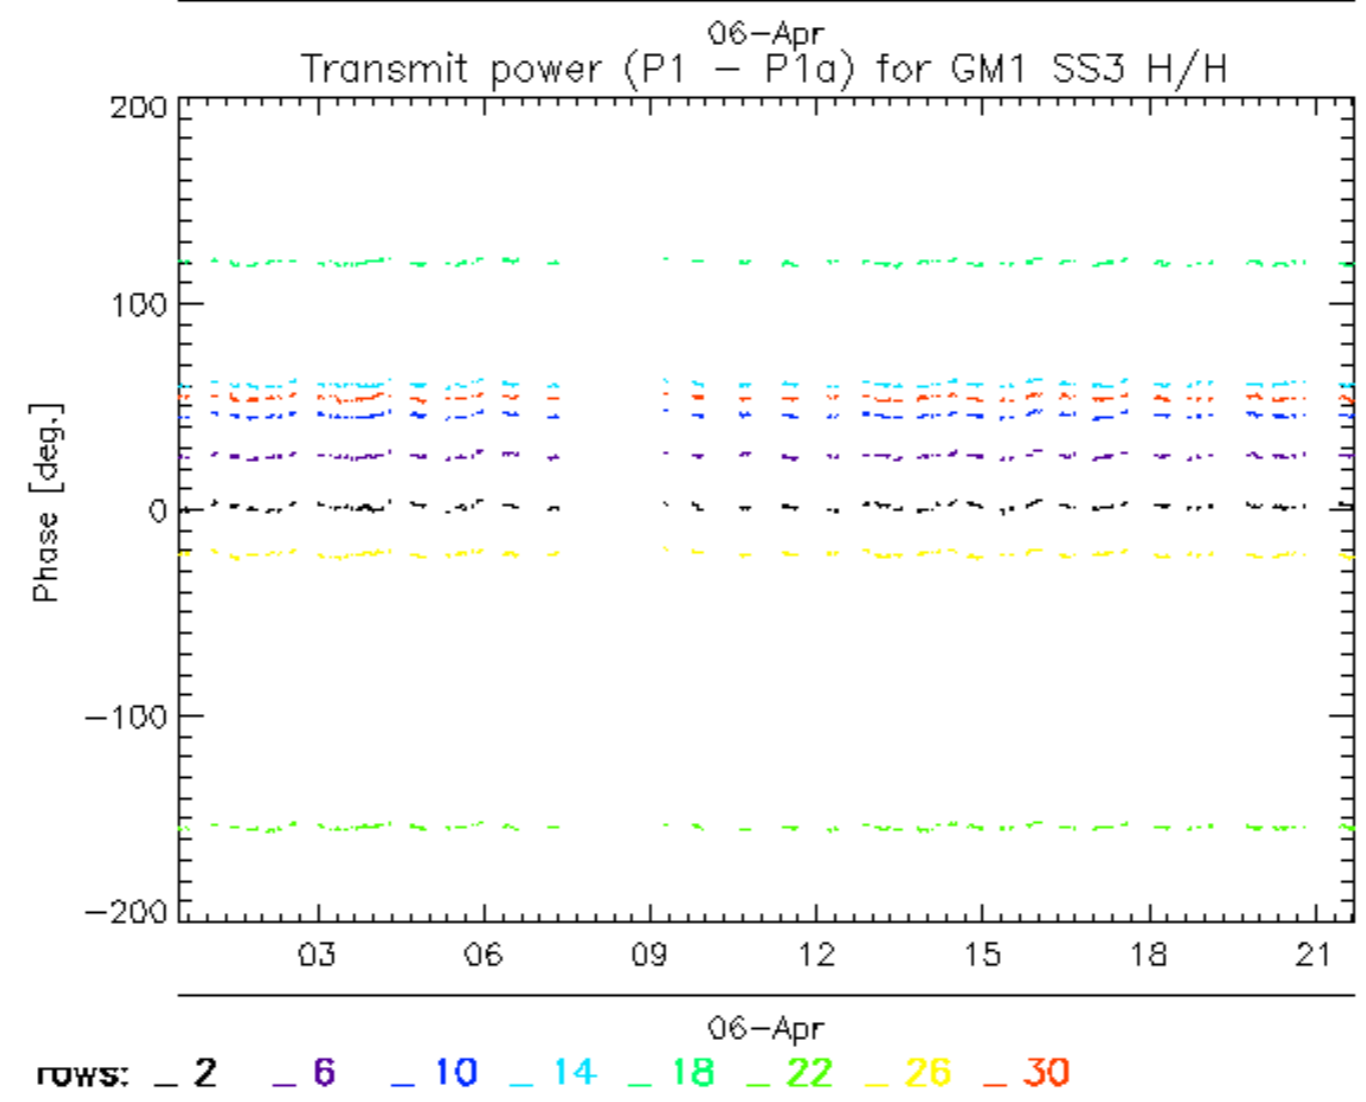
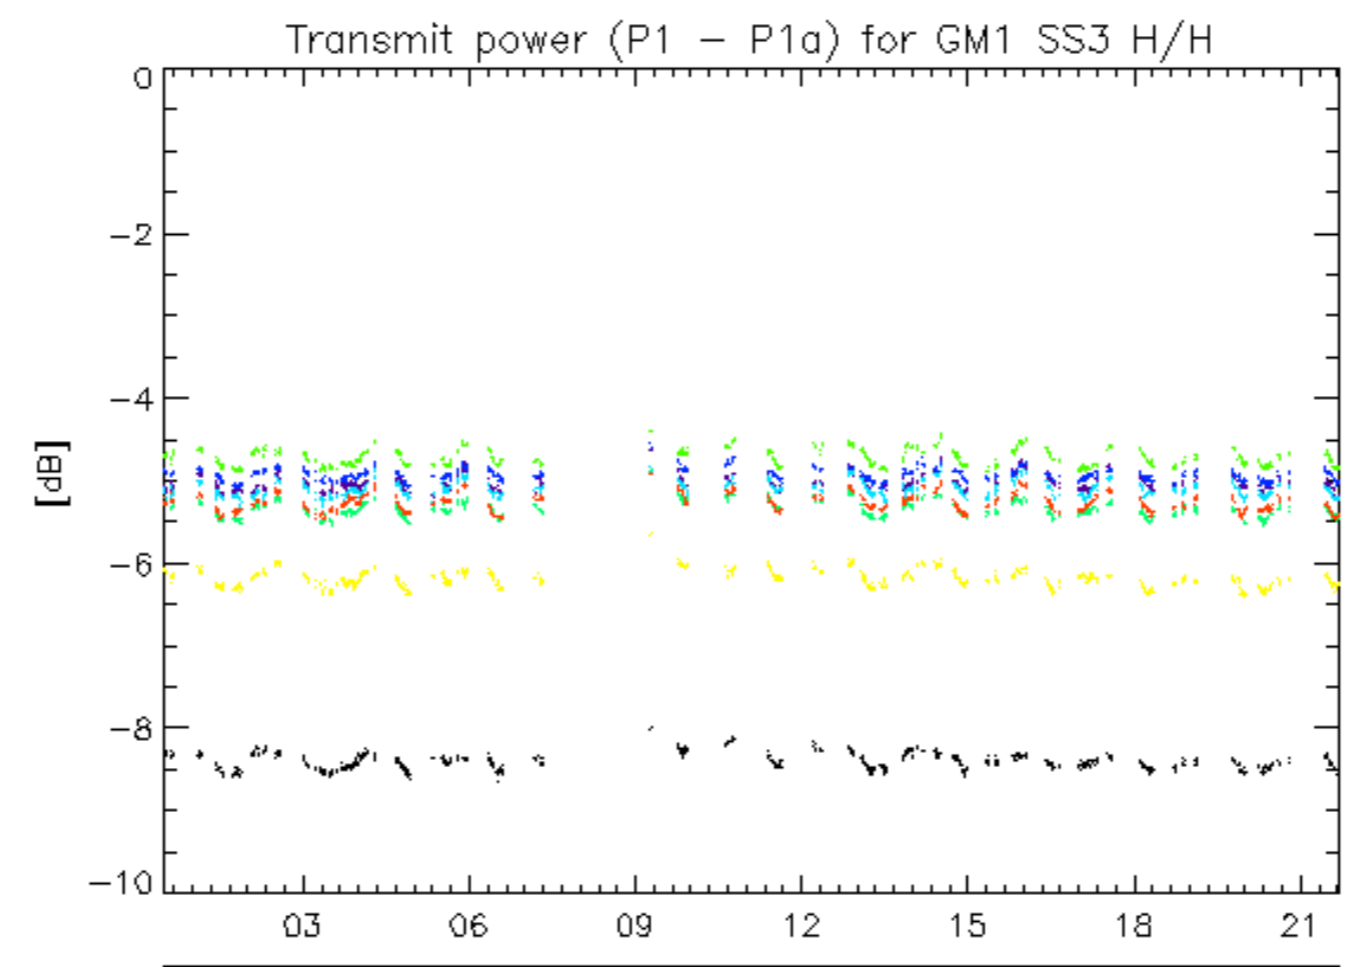


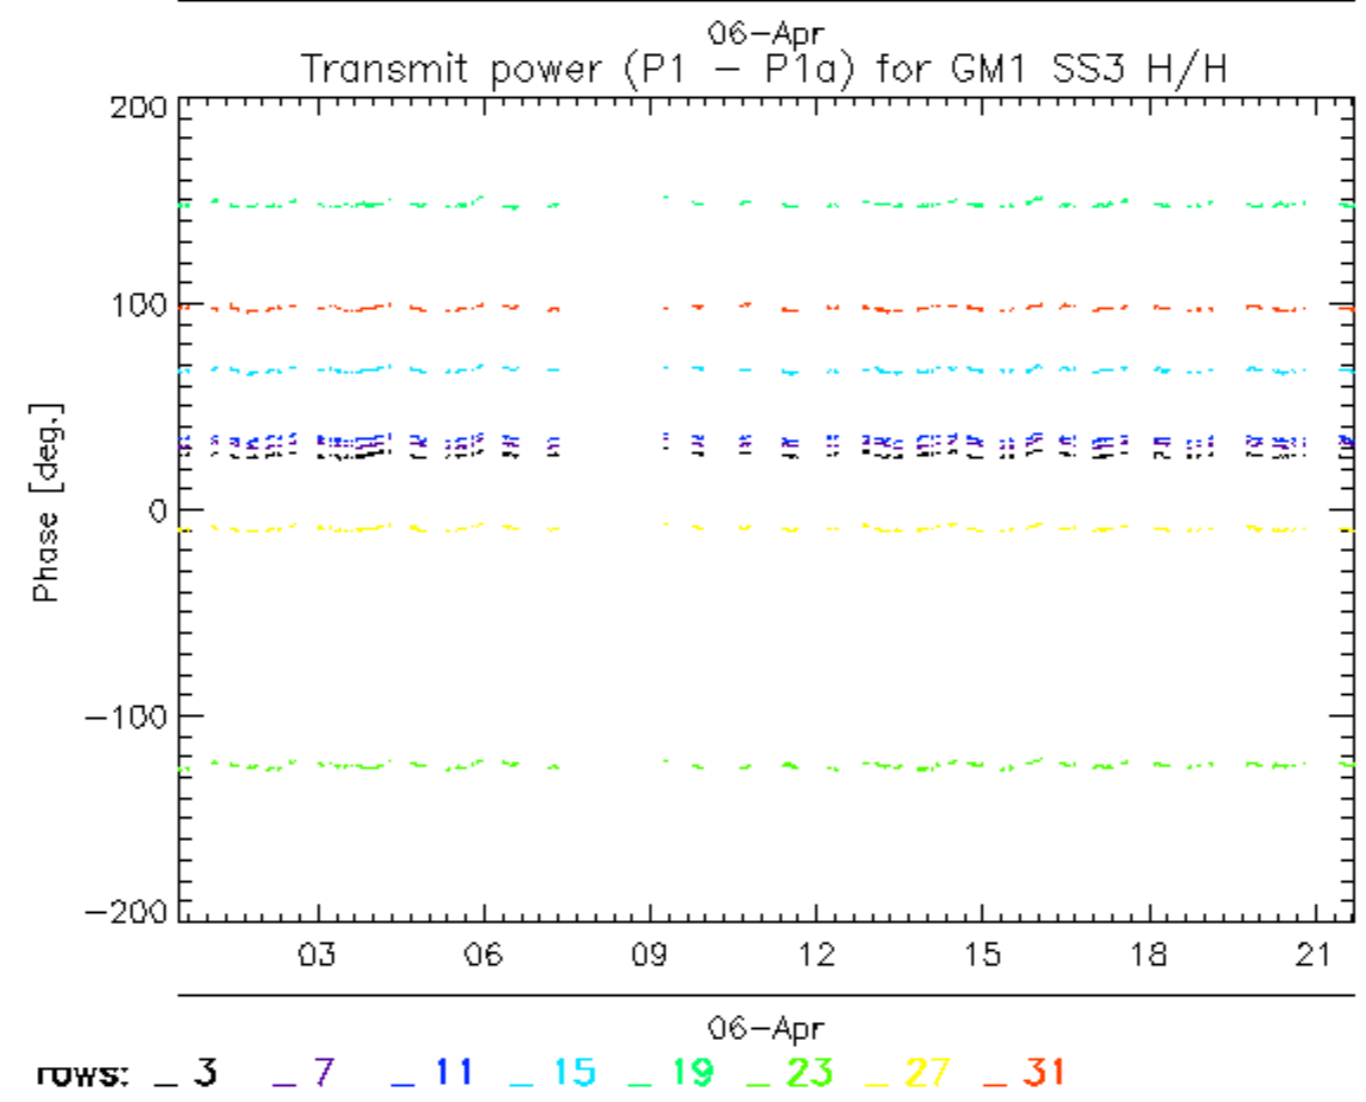
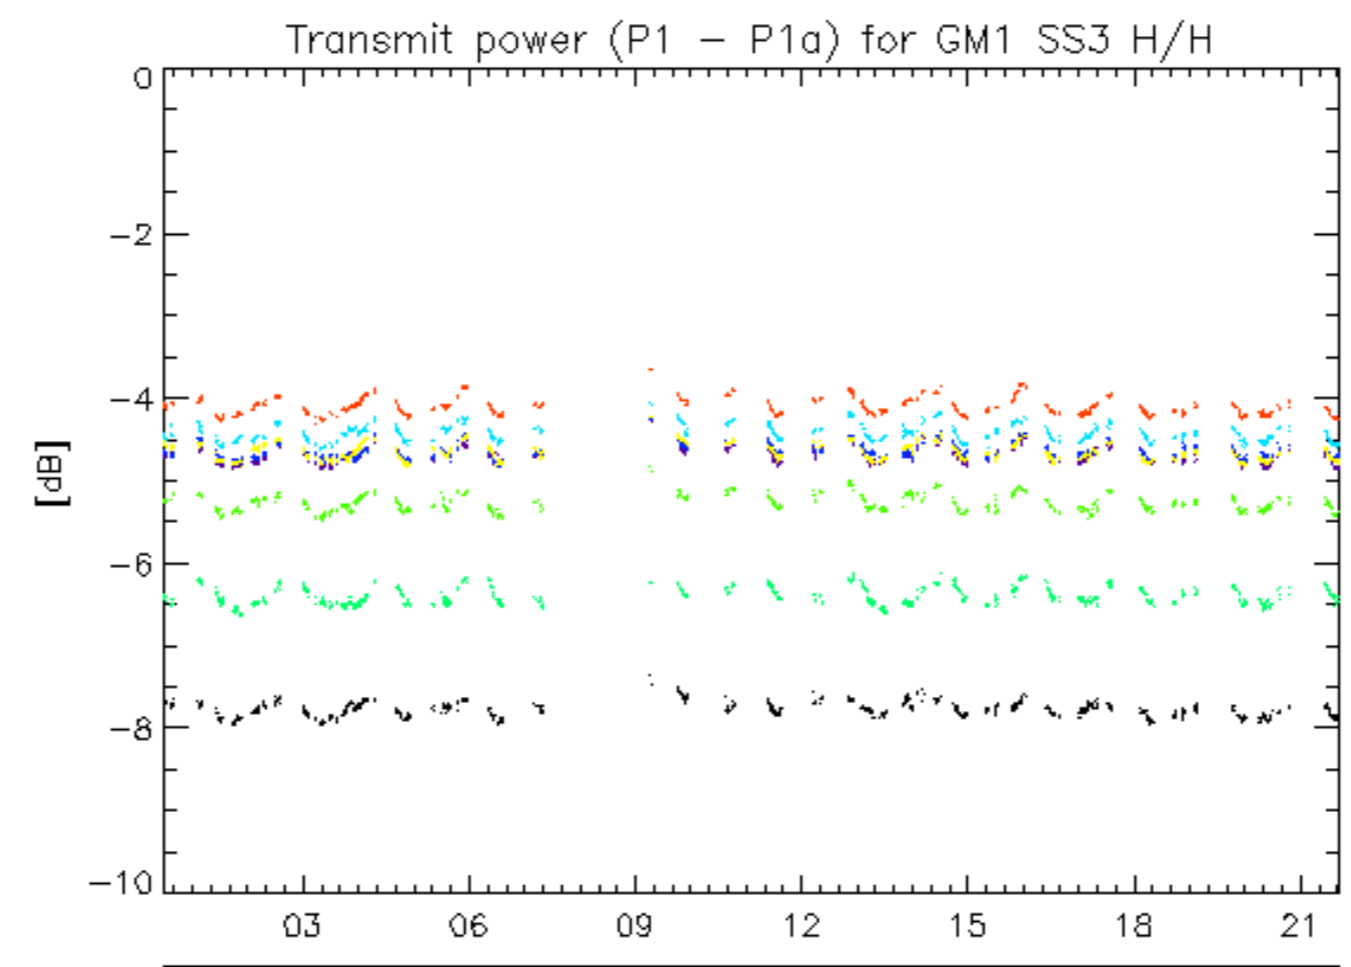


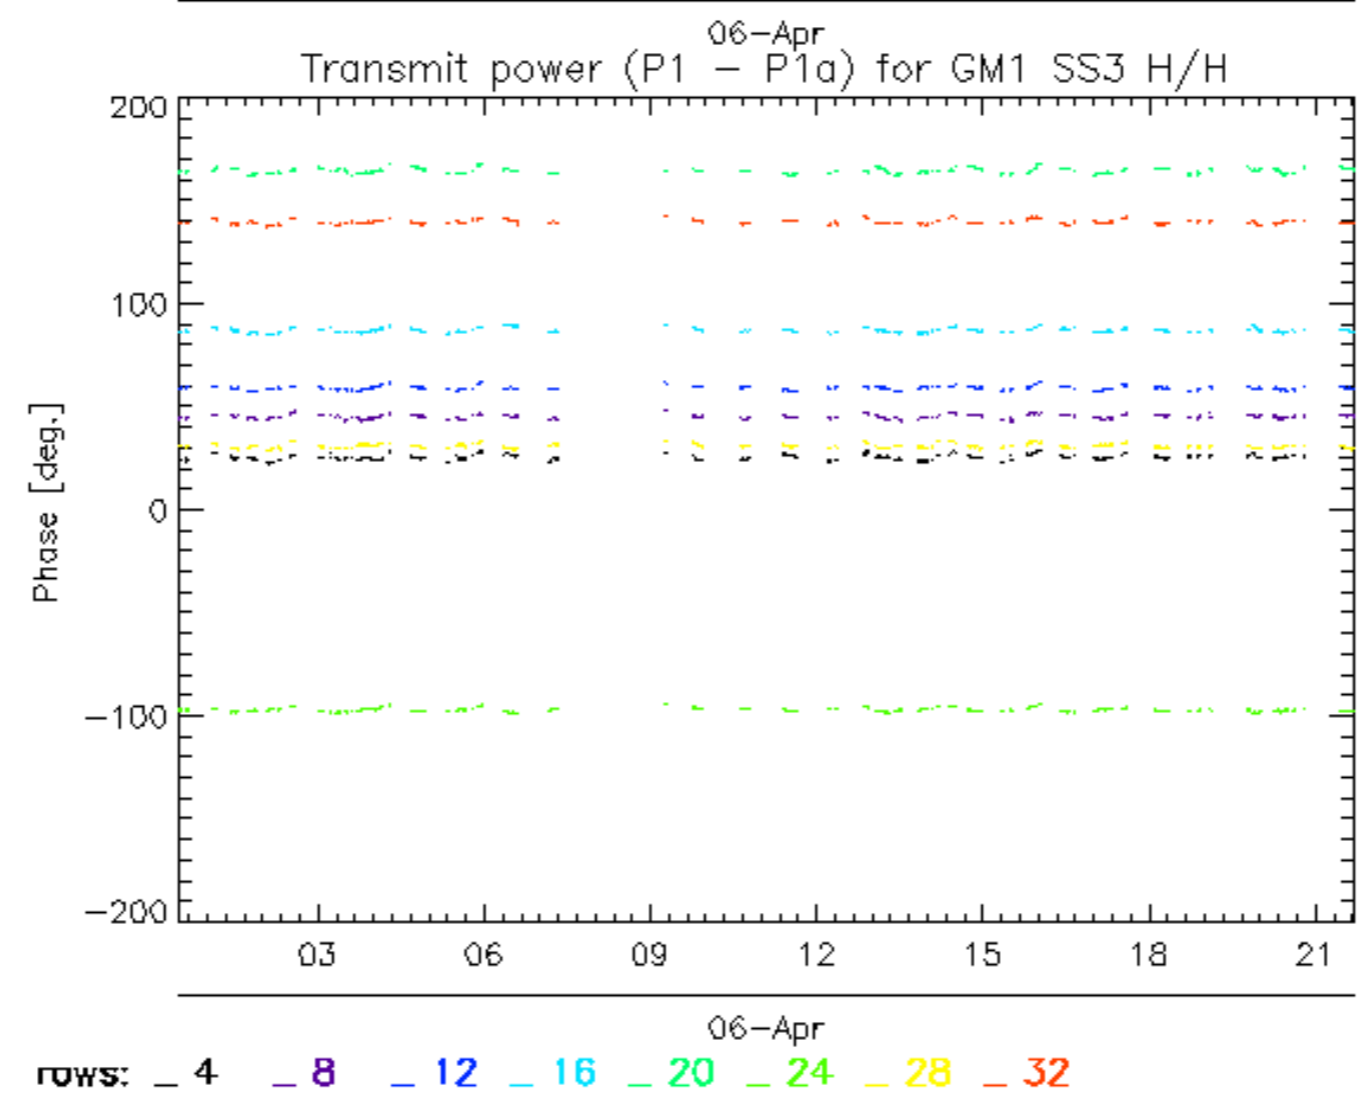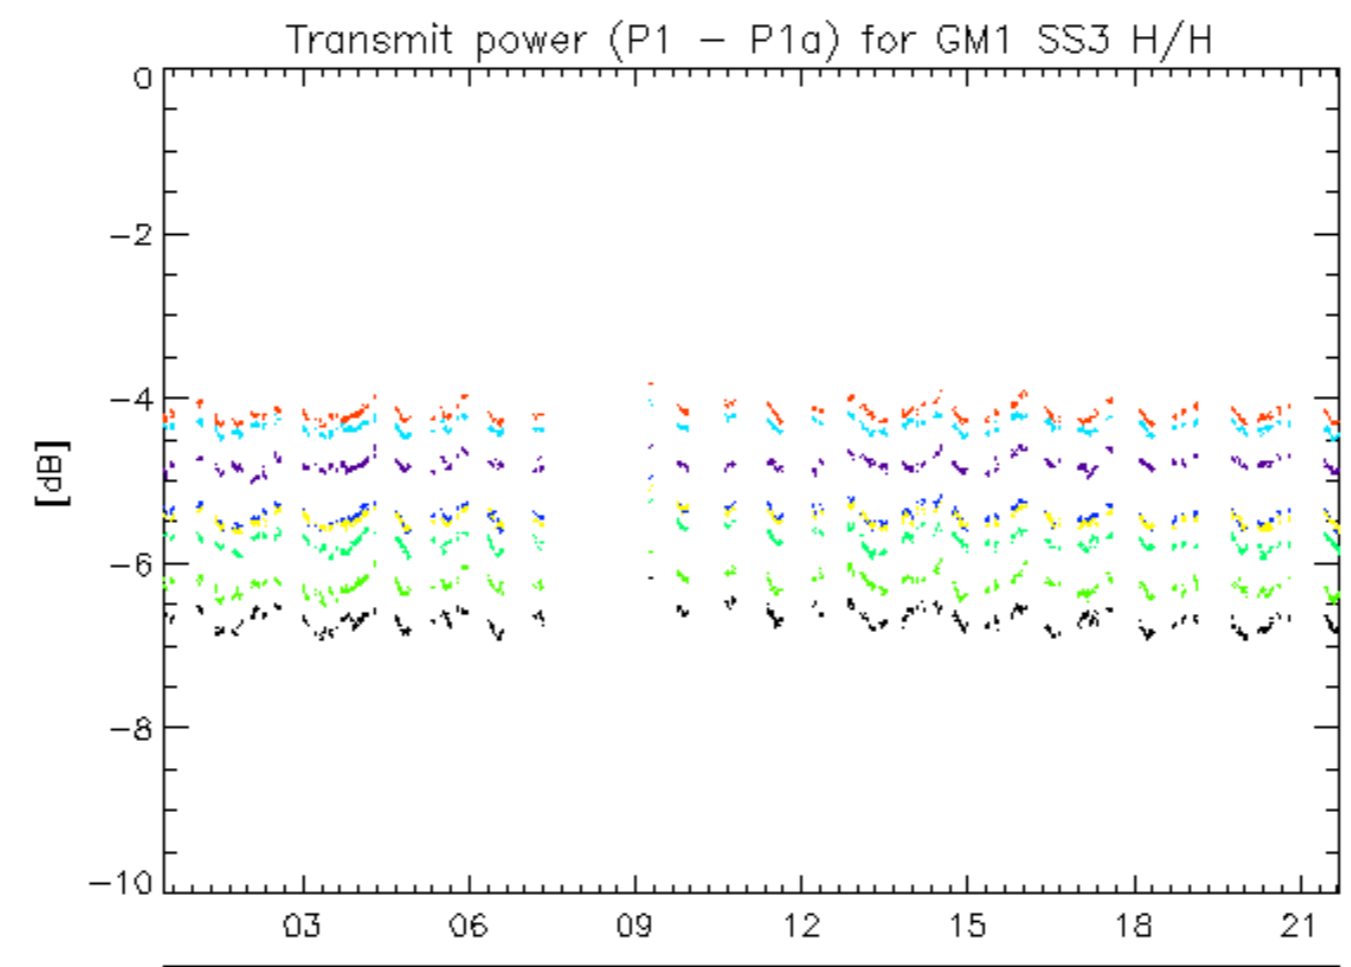


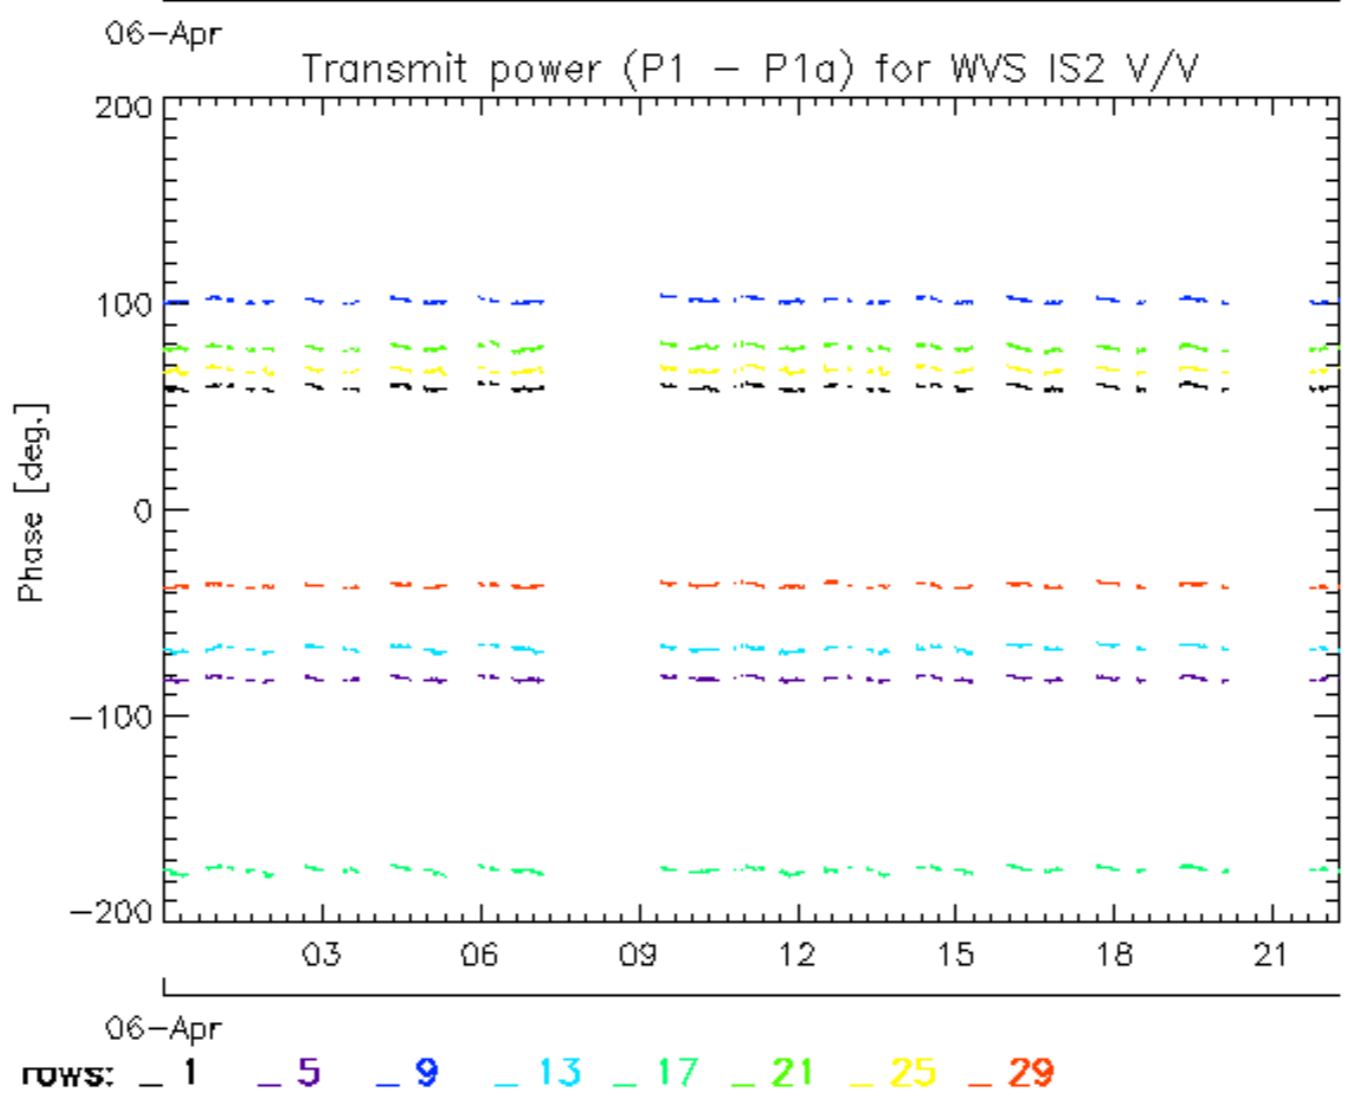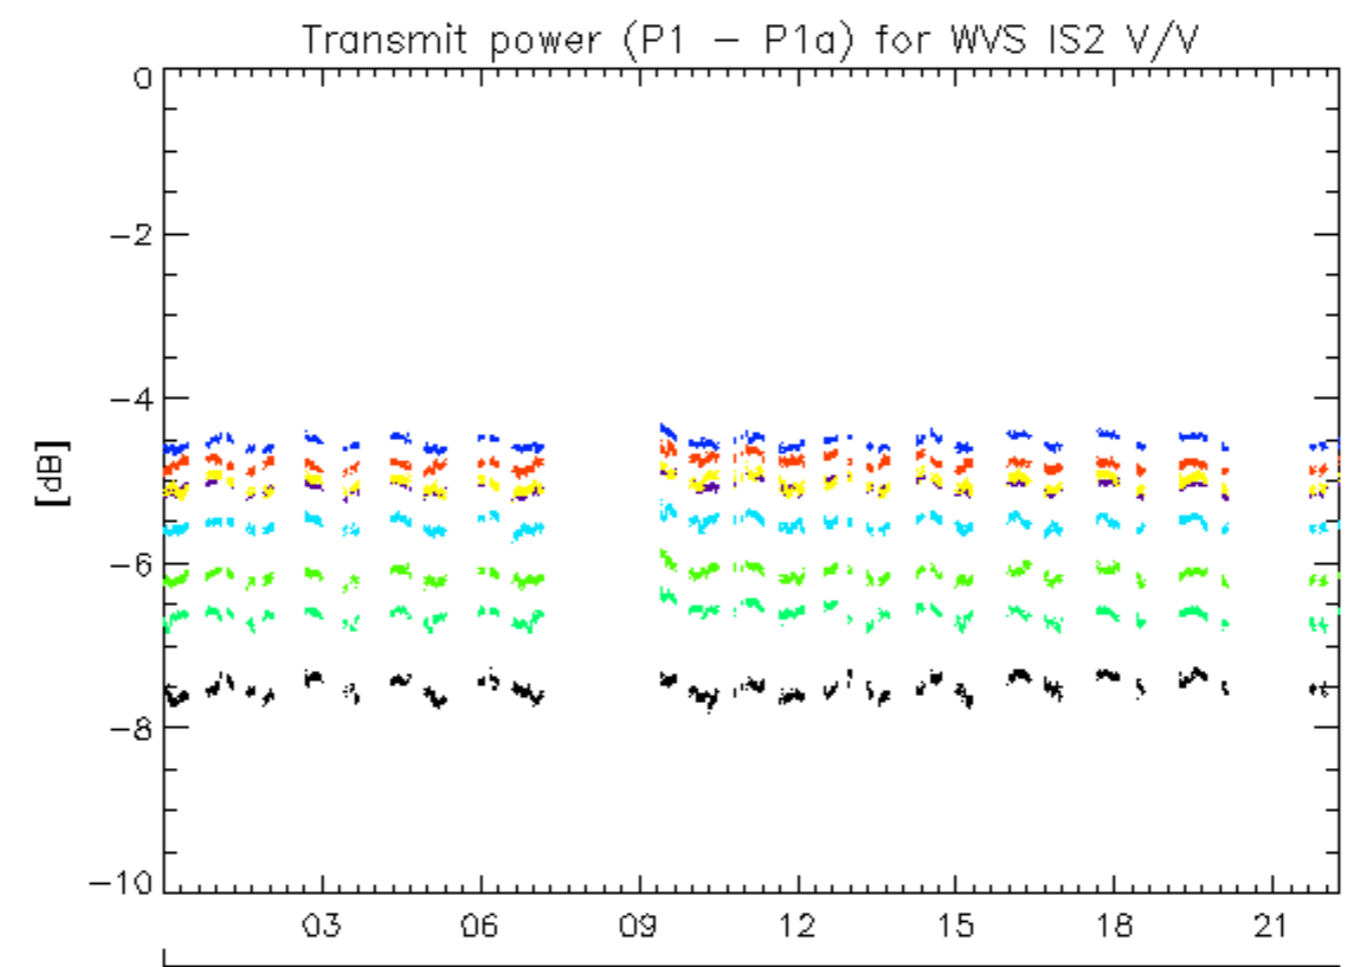


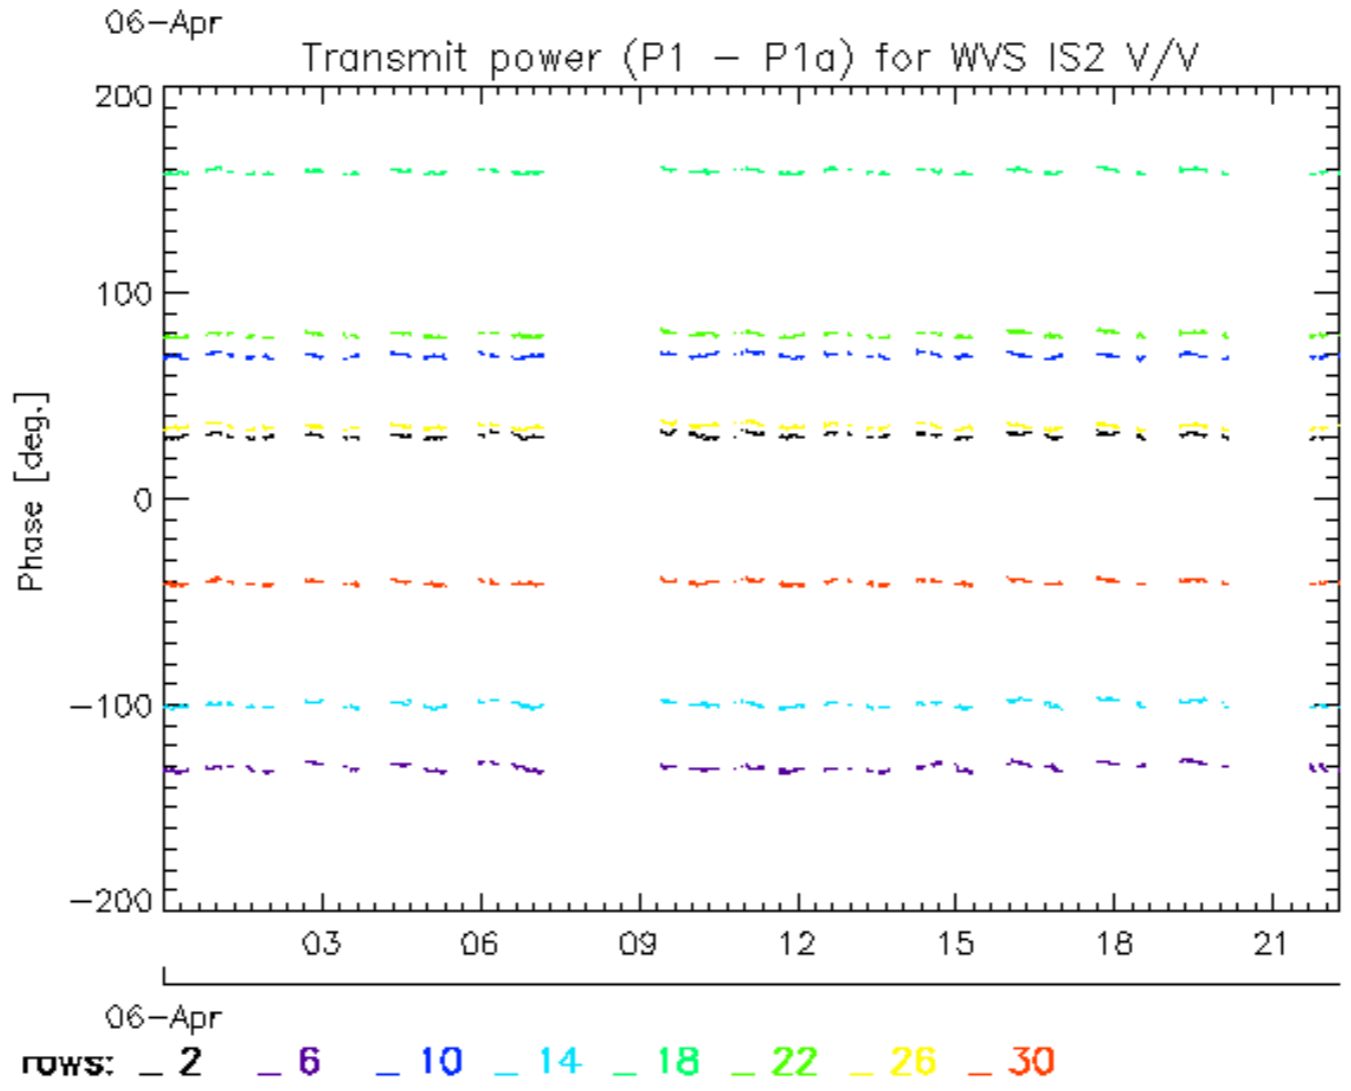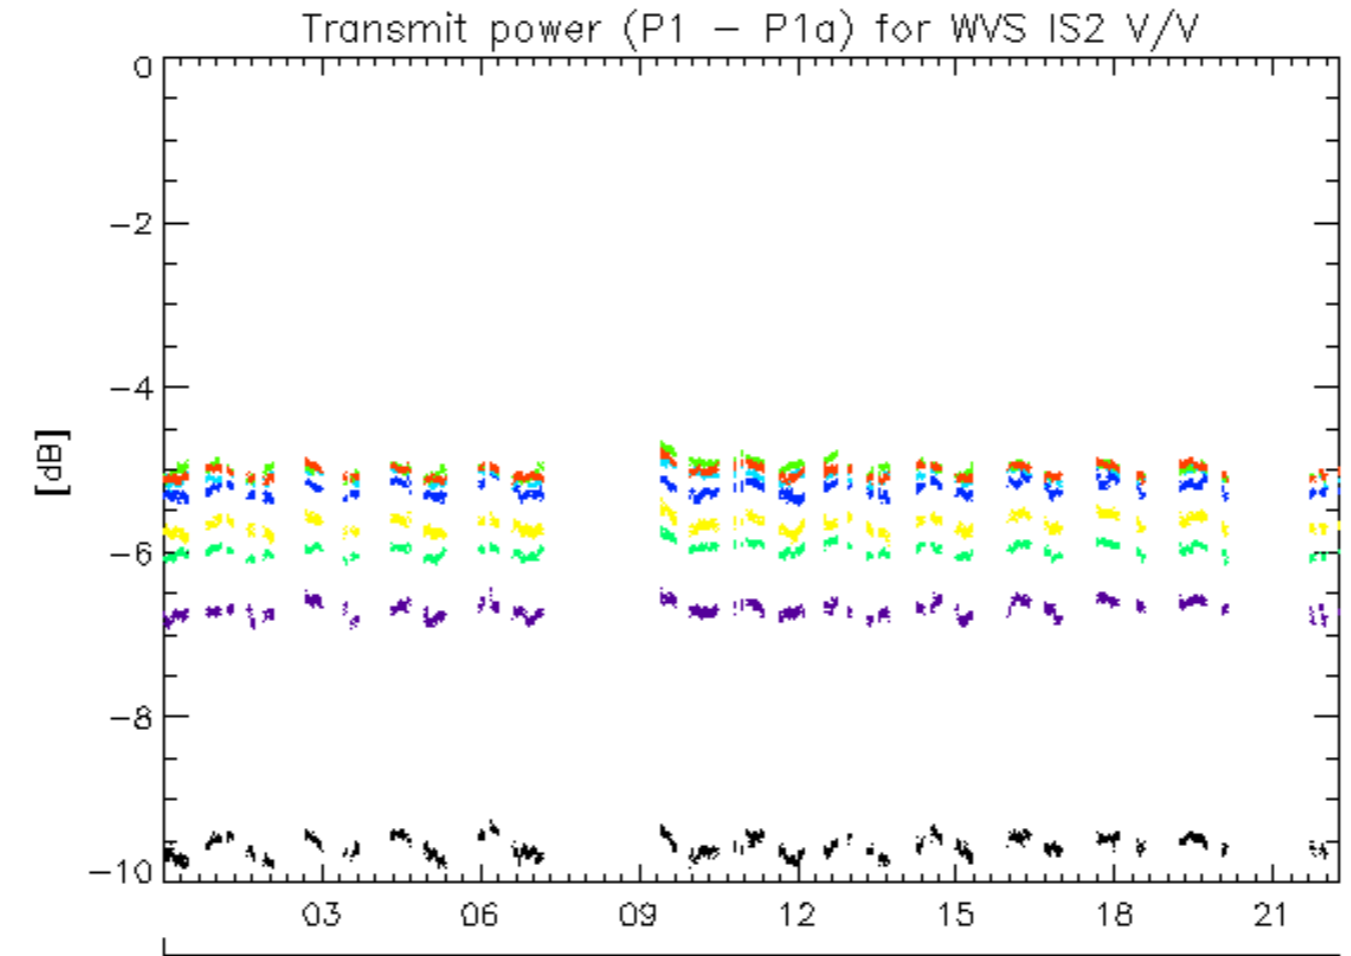


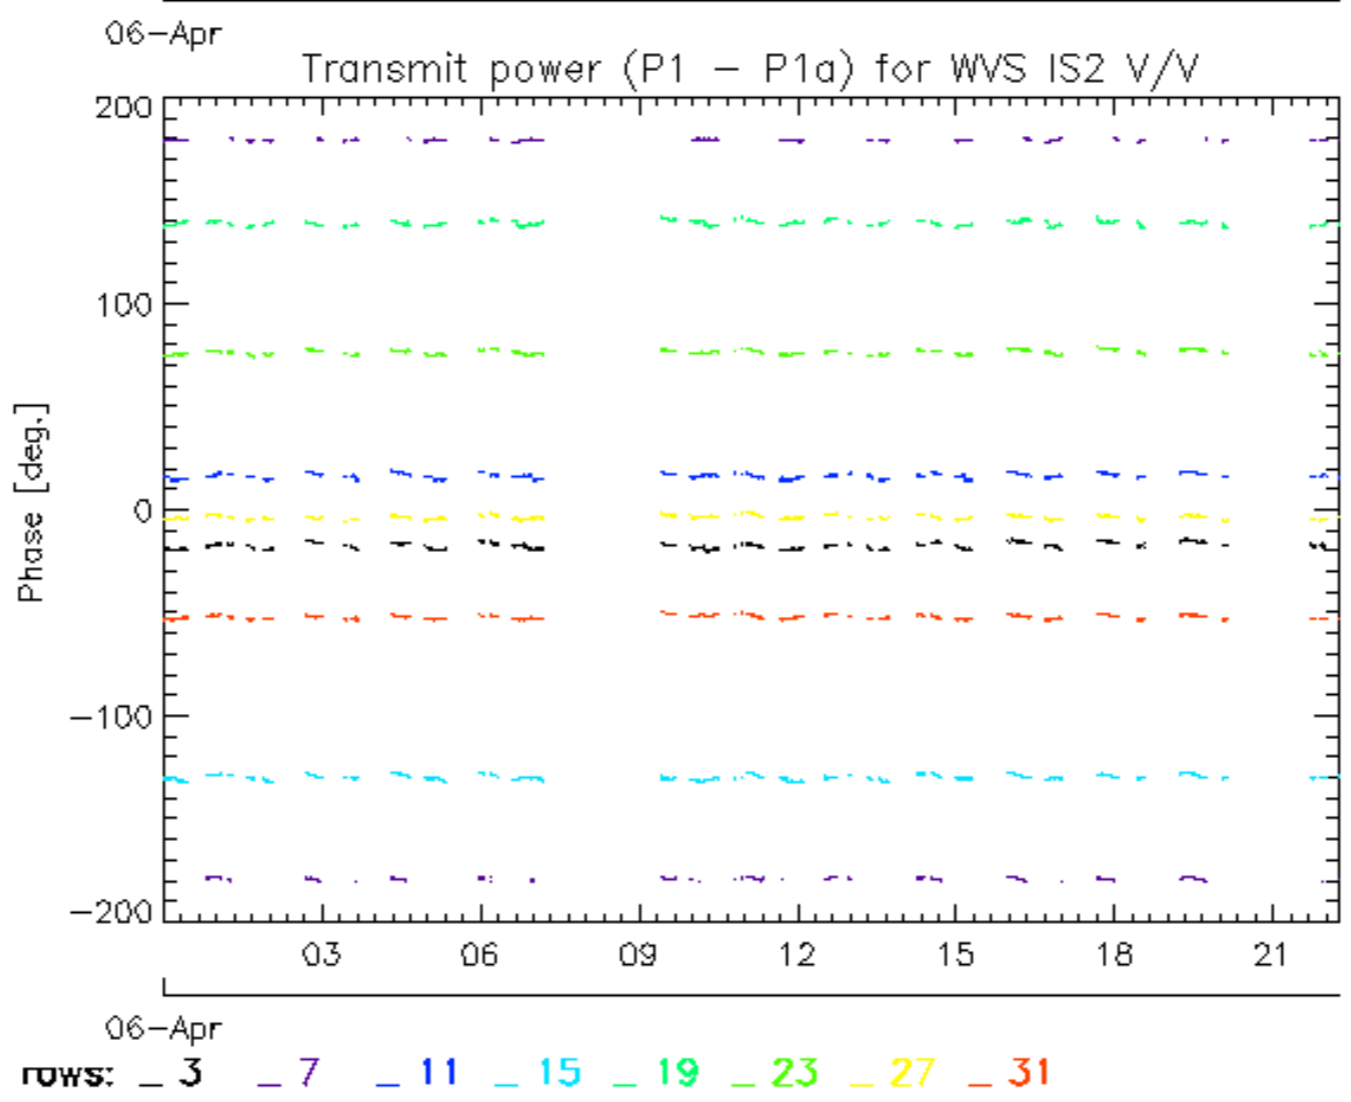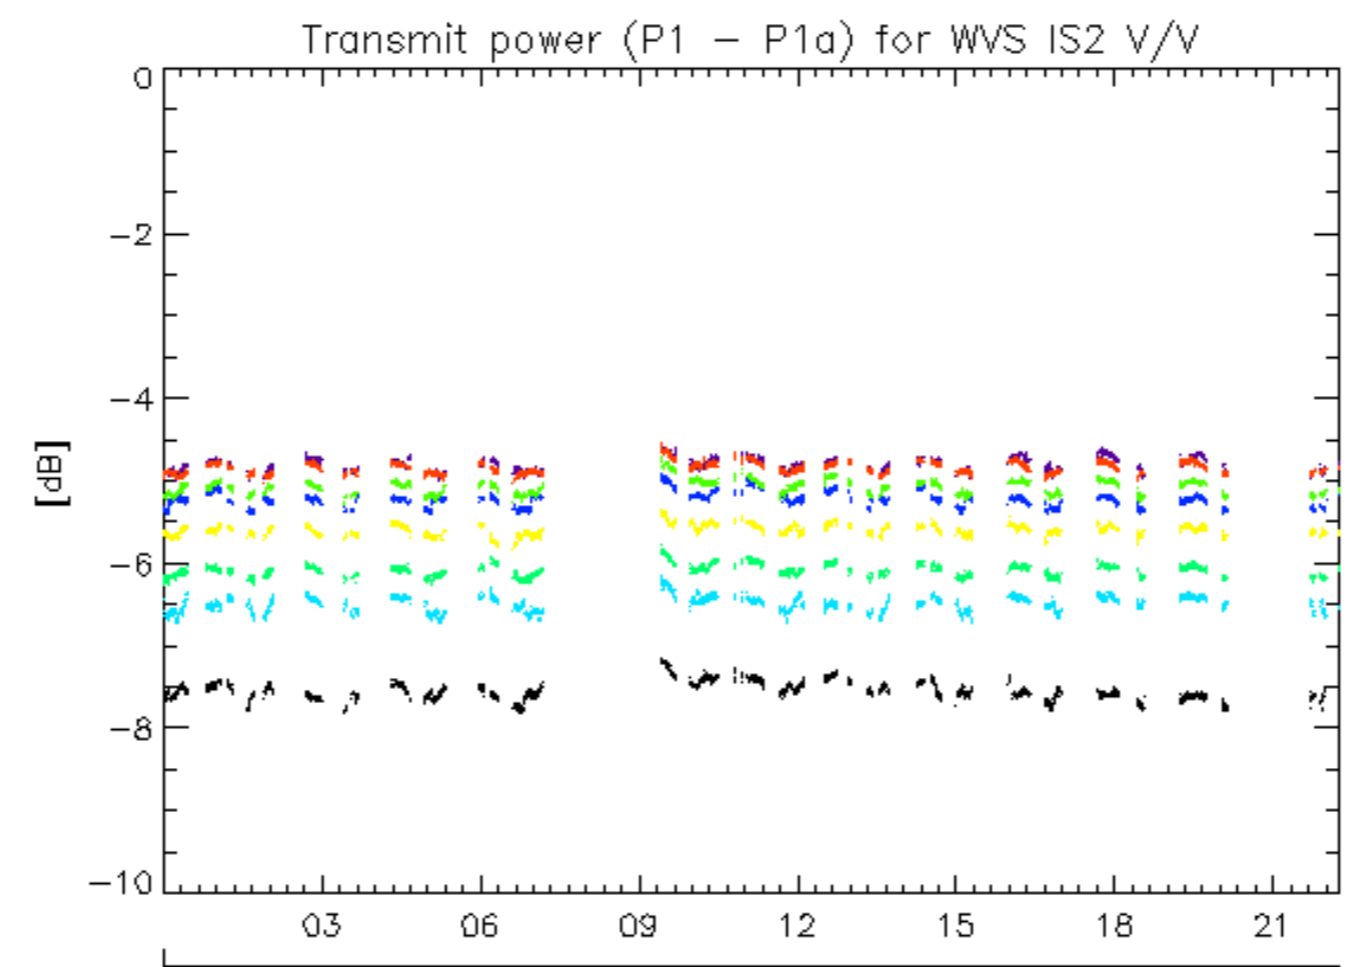


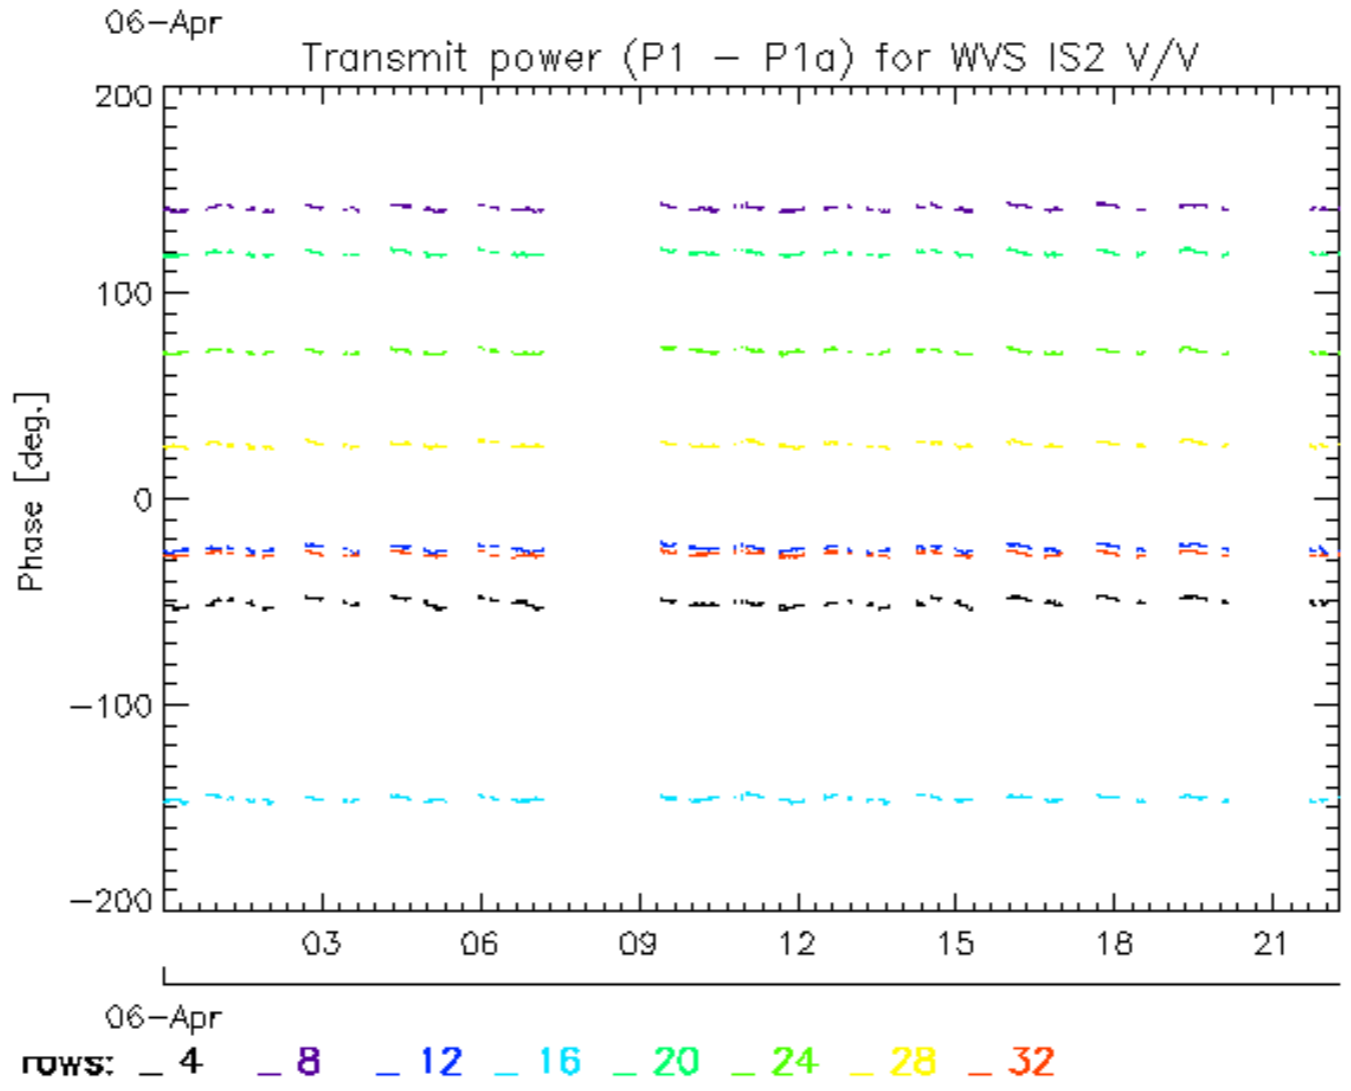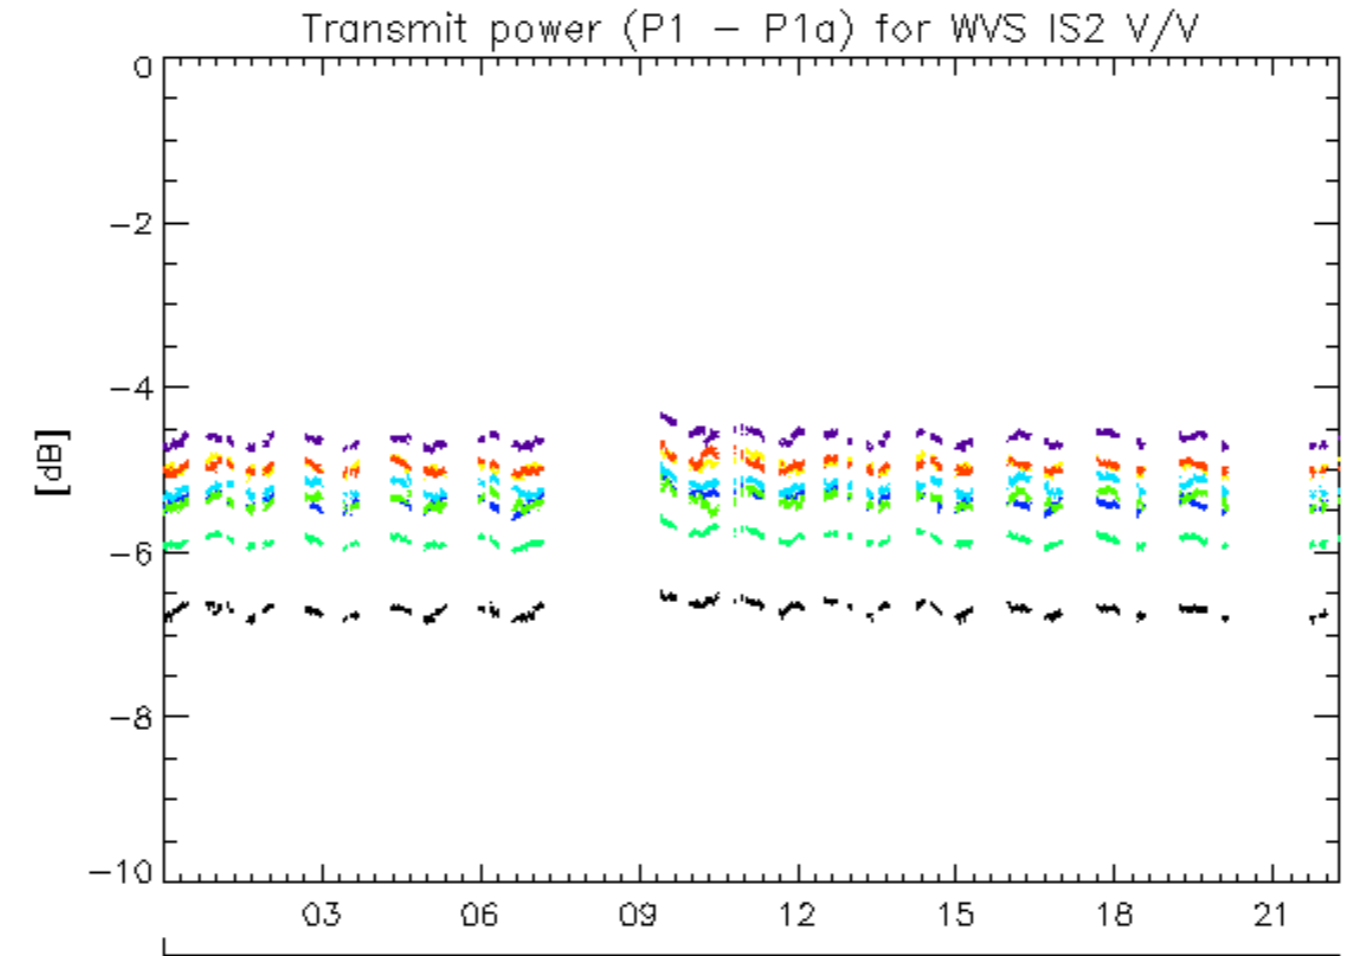

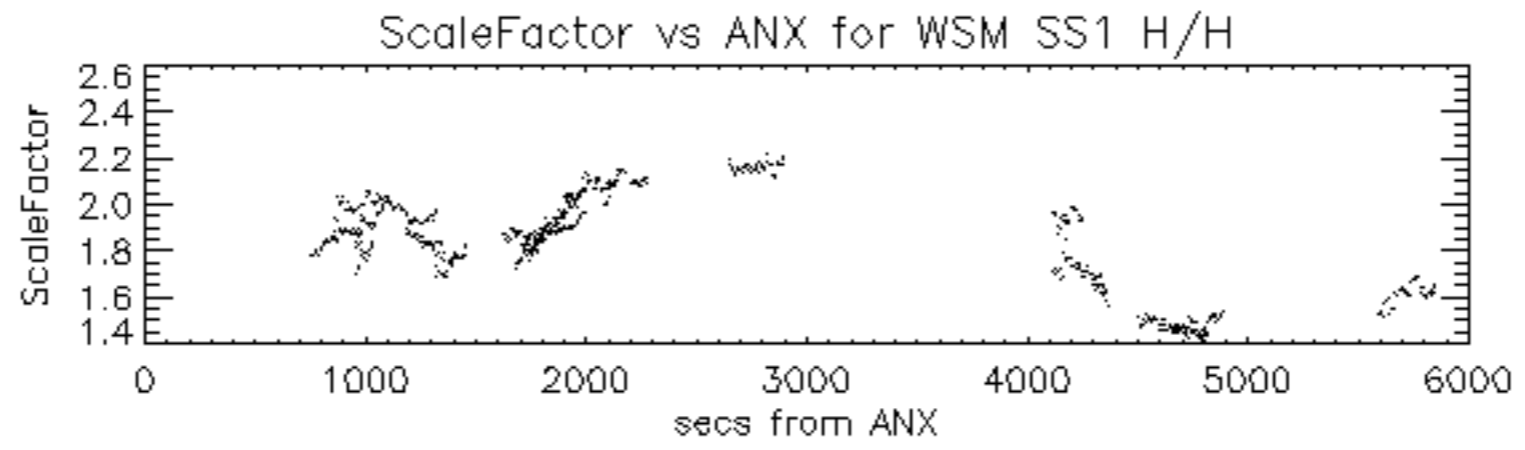

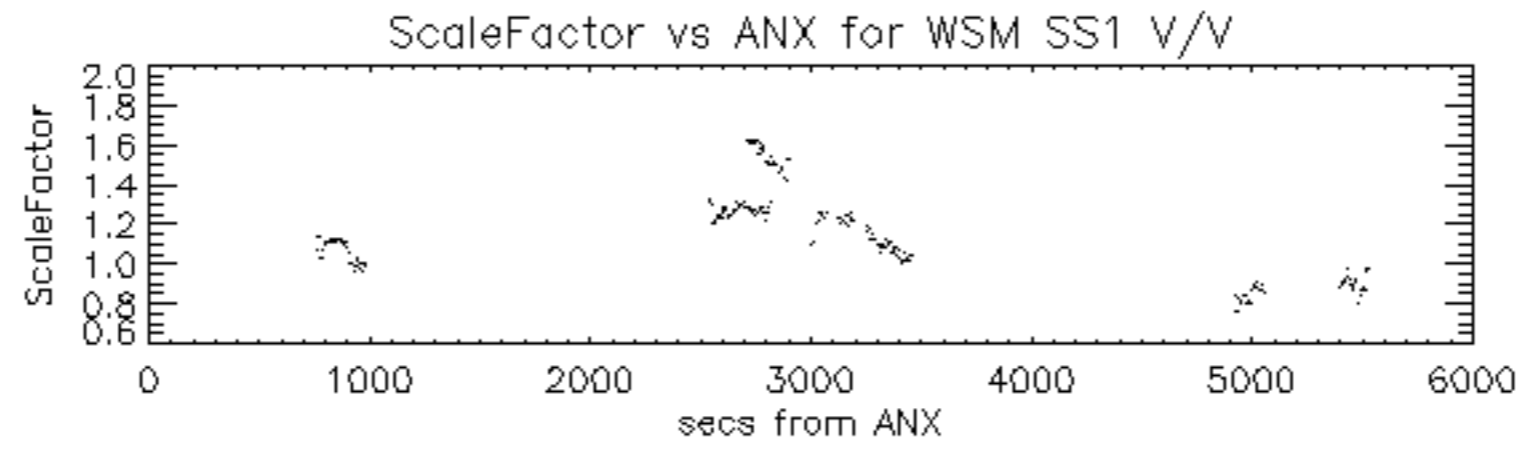

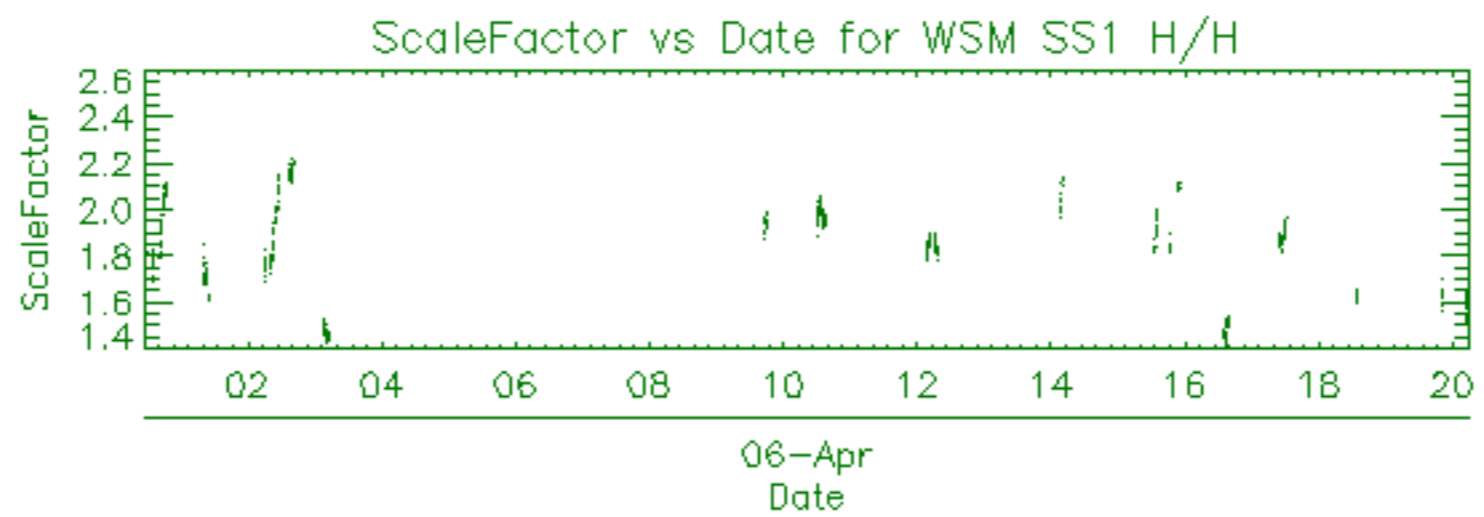

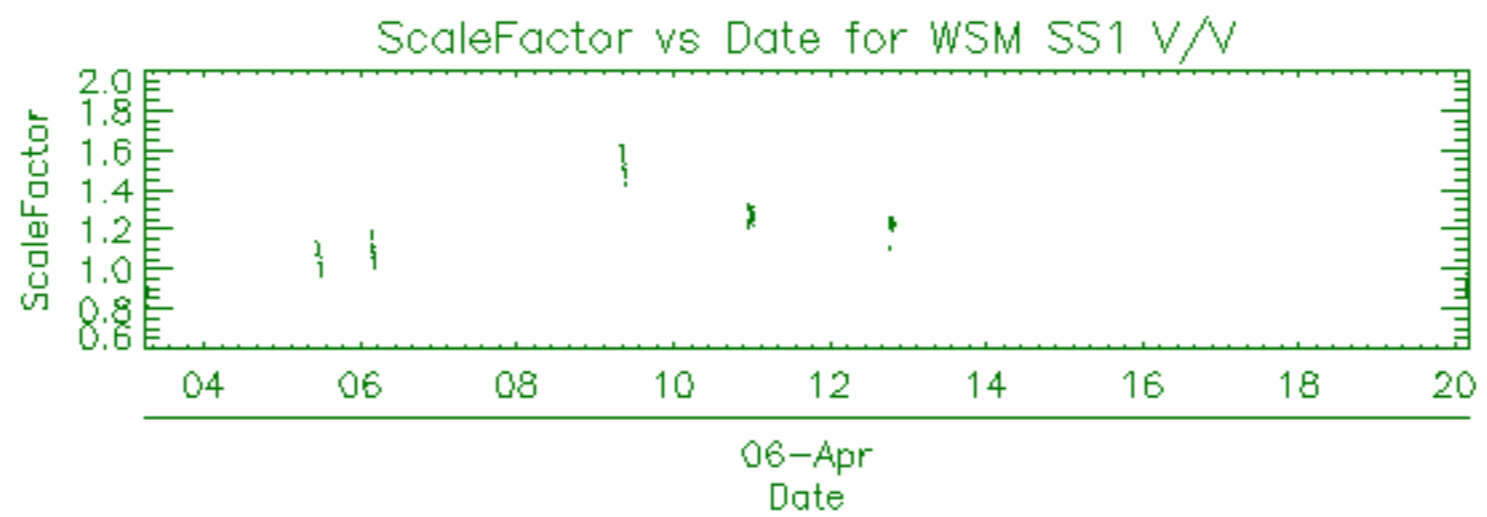

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion			
ASA_APM_1PNPDE20090406_031648_000000562077_00490_37117_3800.N1						IS6	H/H	77	37117 490 4.07




Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_GM1_1PNPDE20090406_002916_000002652077_00489_37116_3518.N1						SS1	H/H	77	37116	489	4.07
ASA_GM1_1PNPDE20090406_003618_000002532077_00489_37116_3523.N1						SS1	H/H	77	37116	489	4.07
ASA_GM1_1PNPDE20090406_010603_000003562077_00489_37116_3525.N1						SS1	H/H	77	37116	489	4.07
ASA_GM1_1PNPDE20090406_012442_000006282077_00489_37116_3533.N1						SS1	H/H	77	37116	489	4.07
ASA_GM1_1PNPDE20090406_014357_000006042077_00489_37116_3661.N1						SS1	H/H	77	37116	489	4.07
ASA_GM1_1PNPDE20090406_020439_000005072077_00490_37117_3663.N1						SS1	H/H	77	37117	490	4.07
ASA_GM1_1PNPDE20090406_021610_000002412077_00490_37117_3665.N1						SS1	H/H	77	37117	490	4.07
ASA_GM1_1PNPDE20090406_022852_000001322077_00490_37117_3667.N1						SS1	H/H	77	37117	490	4.07
ASA_GM1_1PNPDE20090406_023151_000002652077_00490_37117_3675.N1						SS1	H/H	77	37117	490	4.07
ASA_GM1_1PNPDE20090406_025941_000004532077_00490_37117_3842.N1						SS1	H/H	77	37117	490	4.07
ASA_GM1_1PNPDE20090406_031252_00000782077_00490_37117_3840.N1						SS1	H/H	77	37117	490	4.07
ASA_GM1_1PNPDE20090406_031852_000002472077_00490_37117_3838.N1						SS1	H/H	77	37117	490	4.07
ASA_GM1_1PNPDE20090406_032305_000001322077_00490_37117_3836.N1						SS1	H/H	77	37117	490	4.07
ASA_GM1_1PNPDE20090406_032755_000003262077_00490_37117_3824.N1						SS1	H/H	77	37117	490	4.07
ASA_GM1_1PNPDE20090406_033530_000000962077_00491_37118_3813.N1						SS1	H/H	77	37118	491	4.07
ASA_GM1_1PNPDE20090406_034104_000009302077_00491_37118_3829.N1						SS1	H/H	77	37118	491	4.07
ASA_GM1_1PNPDE20090406_034104_000017452077_00491_37118_3941.N1						SS1	H/H	77	37118	491	4.07
ASA_GM1_1PNPDE20090406_041625_000001322077_00491_37118_3808.N1						SS1	H/H	77	37118	491	4.07
ASA_GM1_1PNPDE20090406_044017_000009302077_00491_37118_3991.N1						SS1	H/H	77	37118	491	4.07
ASA_GM1_1PNPDE20090406_052000_000001692077_00492_37119_3993.N1						SS1	H/H	77	37119	492	4.07
ASA_GM1_1PNPDE20090406_053017_000006222077_00492_37119_4009.N1						SS1	H/H	77	37119	492	4.07
ASA_GM1_1PNPDE20090406_054624_000001202077_00492_37119_3995.N1						SS1	H/H	77	37119	492	4.07
ASA_GM1_1PNPDE20090406_055239_000003502077_00492_37119_4017.N1						SS1	H/H	77	37119	492	4.07
ASA_GM1_1PNPDK20090406_062053_000004162077_00492_37119_2605.N1						SS1	H/H	77	37119	492	4.07
ASA_GM1_1PNPDK20090406_062926_000004532077_00492_37119_2610.N1						SS1	H/H	77	37119	492	4.07
ASA_GM1_1PNPDK20090406_071036_000001322077_00493_37120_2612.N1						SS1	H/H	77	37120	493	4.07
ASA_GM1_1PNPDK20090406_071544_000002772077_00493_37120_2633.N1						SS1	H/H	77	37120	493	4.07
ASA_GM1_1PNPDK20090406_091615_000000722077_00494_37121_2771.N1						SS1	H/H	77	37121	494	4.07
ASA_GM1_1PNPDK20090406_094547_000007372077_00494_37121_2776.N1						SS1	H/H	77	37121	494	4.07
ASA_GM1_1PNPDK20090406_103743_000002592077_00495_37122_2785.N1						SS1	H/H	77	37122	495	4.07
ASA_GM1_1PNPDK20090406_104429_000001812077_00495_37122_2955.N1						SS1	H/H	77	37122	495	4.07
ASA_GM1_1PNPDK20090406_112241_000009302077_00495_37122_2965.N1						SS1	H/H	77	37122	495	4.07
ASA_GM1_1PNPDK20090406_121234_000001752077_00496_37123_2963.N1						SS1	H/H	77	37123	496	4.07
ASA_GM1_1PNPDK20090406_122012_000001442077_00496_37123_2967.N1						SS1	H/H	77	37123	496	4.07
ASA_GM1_1PNPDK20090406_124926_000003682077_00496_37123_3082.N1						SS1	H/H	77	37123	496	4.07
ASA_GM1_1PNPDK20090406_125541_000001082077_00496_37123_3084.N1						SS1	H/H	77	37123	496	4.07
ASA_GM1_1PNPDK20090406_130434_000008822077_00496_37123_3092.N1						SS1	H/H	77	37123	496	4.07
ASA_GM1_1PNPDK20090406_132506_000004712077_00496_37123_3097.N1						SS1	H/H	77	37123	496	4.07
ASA_GM1_1PNPDK20090406_134852_000007852077_00497_37124_3103.N1						SS1	H/H	77	37124	497	4.07
ASA_GM1_1PNPDK20090406_140445_000000902077_00497_37124_3208.N1						SS1	H/H	77	37124	497	4.07
ASA_GM1_1PNPDK20090406_141029_000001142077_00497_37124_3210.N1						SS1	H/H	77	37124	497	4.07
ASA_GM1_1PNPDK20090406_142345_000002892077_00497_37124_3215.N1						SS1	H/H	77	37124	497	4.07
ASA_GM1_1PNPDK20090406_143001_000000962077_00497_37124_3217.N1						SS1	H/H	77	37124	497	4.07
ASA_GM1_1PNPDK20090406_144353_000009302077_00497_37124_3222.N1						SS1	H/H	77	37124	497	4.07
ASA_GM1_1PNPDK20090406_151933_000002532077_00498_37125_3224.N1						SS1	H/H	77	37125	498	4.07
ASA_GM1_1PNPDK20090406_152816_000002772077_00498_37125_3226.N1						SS1	H/H	77	37125	498	4.07
ASA_GM1_1PNPDK20090406_154724_000003742077_00498_37125_3336.N1						SS1	H/H	77	37125	498	4.07
ASA_GM1_1PNPDK20090406_155521_000002412077_00498_37125_3338.N1						SS1	H/H	77	37125	498	4.07
ASA_GM1_1PNPDK20090406_160123_000001202077_00498_37125_3343.N1						SS1	H/H	77	37125	498	4.07
ASA_GM1_1PNPDK20090406_162429_000005552077_00498_37125_3345.N1						SS1	H/H	77	37125	498	4.07
ASA_GM1_1PNPDK20090406_163902_000000902077_00498_37125_3350.N1						SS1	H/H	77	37125	498	4.07
ASA_GM1_1PNPDK20090406_165940_000010032077_00499_37126_3430.N1						SS1	H/H	77	37126	499	4.07
ASA_GM1_1PNPDK20090406_171511_000001022077_00499_37126_3459.N1						SS1	H/H	77	37126	499	4.07
ASA_GM1_1PNPDK20090406_171830_000001812077_00499_37126_3461.N1						SS1	H/H	77	37126	499	4.07
ASA_GM1_1PNPDK20090406_173112_000003622077_00499_37126_3463.N1						SS1	H/H	77	37126	499	4.07
ASA_GM1_1PNPDK20090406_180621_000008882077_00499_37126_3473.N1						SS1	H/H	77	37126	499	4.07
ASA_GM1_1PNPDK20090406_184216_000002352077_00500_37127_3471.N1						SS1	H/H	77	37127	500	4.07
ASA_GM1_1PNPDK20090406_185110_000002412077_00500_37127_3475.N1						SS1	H/H	77	37127	500	4.07
ASA_GM1_1PNPDK20090406_190441_000002832077_00500_37127_3578.N1						SS1	H/H	77	37127	500	4.07
ASA_GM1_1PNPDK20090406_194541_000001812077_00500_37127_3580.N1						SS1	H/H	77	37127	500	4.07
ASA_GM1_1PNPDK20090406_195222_000005612077_00500_37127_3585.N1						SS1	H/H	77	37127	500	4.07
ASA_GM1_1PNPDK20090406_201453_000008882077_00500_37127_3590.N1						SS1	H/H	77	37127	500	4.07
ASA_GM1_1PNPDE20090406_203551_000001322077_00501_37128_4491.N1						SS1	H/H	77	37128	501	4.07
ASA_GM1_1PNPDE20090406_204717_000000902077_00501_37128_4493.N1						SS1	H/H	77	37128	501	4.07
ASA_GM1_1PNPDE20090406_212617_000009302077_00501_37128_4498.N1						SS1	H/H	77	37128	501	4.07


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20090406_021303_000000532077_00490_37117_3738.N1						IS2	V/V	77	37117	490	4.07
ASA_IMM_1PNPDE20090406_022501_000000672077_00490_37117_3771.N1						IS2	V/V	77	37117	490	4.07
ASA_IMM_1PNPDE20090406_023103_000000342077_00490_37117_3756.N1						IS2	V/V	77	37117	490	4.07
ASA_IMM_1PNPDE20090406_041009_000002422077_00491_37118_3943.N1						IS2	V/V	77	37118	491	4.07
ASA_IMM_1PNPDE20090406_041009_000003632077_00491_37118_3947.N1						IS2	V/V	77	37118	491	4.07
ASA_IMM_1PNPDE20090406_052249_000001572077_00492_37119_3975.N1						IS2	V/V	77	37119	492	4.07
ASA_IMM_1PNPDE20090406_054825_000001272077_00492_37119_3971.N1						IS2	V/V	77	37119	492	4.07
ASA_IMM_1PNPDE20090406_055106_000000822077_00492_37119_3973.N1						IS2	V/V	77	37119	492	4.07
ASA_IMM_1PNPDE20090406_060418_000001272077_00492_37119_4085.N1						IS2	V/V	77	37119	492	4.07
ASA_IMM_1PNPDK20090406_091053_000000402077_00494_37121_2753.N1						IS2	V/V	77	37121	494	4.07
ASA_IMM_1PNPDE20090406_091316_000000372077_00494_37121_4200.N1						IS2	V/V	77	37121	494	4.07
ASA_IMM_1PNPDE20090406_091527_000000372077_00494_37121_4206.N1						IS2	H/H	77	37121	494	4.07
ASA_IMM_1PNPDE20090406_092313_000000532077_00494_37121_4208.N1						IS2	V/V	77	37121	494	4.07
ASA_IMM_1PNPDE20090406_114204_000000632077_00495_37122_4297.N1						IS2	V/V	77	37122	495	4.07
ASA_IMM_1PNPDK20090406_134425_000000822077_00497_37124_3191.N1						IS2	V/V	77	37124	497	4.07
ASA_IMM_1PNPDE20090406_142833_000000762077_00497_37124_4365.N1						IS2	V/V	77	37124	497	4.07
ASA_IMM_1PNPDE20090406_152344_000002612077_00498_37125_4399.N1						IS2	V/V	77	37125	498	4.07
ASA_IMM_1PNPDK20090406_153913_000001142077_00498_37125_3318.N1						IS2	H/H	77	37125	498	4.07
ASA_IMM_1PNPDE20090406_173711_000002152077_00499_37126_4445.N1						IS2	V/V	77	37126	499	4.07
ASA_IMM_1PNPDE20090406_184608_000001842077_00500_37127_4449.N1						IS6	V/V	77	37127	500	4.07
ASA_IMM_1PNPDE20090406_184952_000000672077_00500_37127_4429.N1						IS1	V/V	77	37127	500	4.07
ASA_IMM_1PNPDK20090406_185509_000000362077_00500_37127_3480.N1						IS2	H/H	77	37127	500	4.07
ASA_IMM_1PNPDK20090406_203043_000000162077_00501_37128_3576.N1						IS2	***	77	37128	501	4.07


Filename	Pol	Timestamp	count(Module)				
ASA_MS__0PNPDK20090406_090709_000000162077_00494_37121_0778.N1	H			2009-04-06	09:07:09	320	
ASA_MS__0PNPDK20090406_180503_000000162077_00499_37126_0779.N1	V			2009-04-06	18:05:03	320	


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WSM_1PNPDE20090406_002737_000000972077_00489_37116_3654.N1						SS1	H/H	77	37116	489	4.07
ASA_WSM_1PNPDE20090406_003343_000001522077_00489_37116_3656.N1						SS1	H/H	77	37116	489	4.07
ASA_WSM_1PNPDE20090406_004037_000001902077_00489_37116_3744.N1						SS1	H/H	77	37116	489	4.07
ASA_WSM_1PNPDE20090406_004037_000004152077_00489_37116_3851.N1						SS1	H/H	77	37116	489	4.07
ASA_WSM_1PNPDE20090406_004448_000000612077_00489_37116_3648.N1						SS1	H/H	77	37116	489	4.07
ASA_WSM_1PNPDE20090406_004650_000000422077_00489_37116_3652.N1						SS1	H/H	77	37116	489	4.07
ASA_WSM_1PNPDE20090406_012014_000002502077_00489_37116_3762.N1						SS1	H/H	77	37116	489	4.07
ASA_WSM_1PNPDE20090406_021419_000001092077_00490_37117_3783.N1						SS1	H/H	77	37117	490	4.07
ASA_WSM_1PNPDE20090406_022013_000001342077_00490_37117_3798.N1						SS1	H/H	77	37117	490	4.07
ASA_WSM_1PNPDE20090406_022013_000002692077_00490_37117_3916.N1						SS1	H/H	77	37117	490	4.07
ASA_WSM_1PNPDE20090406_022322_000000612077_00490_37117_3779.N1						SS1	H/H	77	37117	490	4.07
ASA_WSM_1PNPDE20090406_022655_000001162077_00490_37117_3796.N1						SS1	H/H	77	37117	490	4.07
ASA_WSM_1PNPDE20090406_023620_000002692077_00490_37117_3785.N1						SS1	H/H	77	37117	490	4.07
ASA_WSM_1PNPDE20090406_030718_000000732077_00490_37117_3856.N1						SS1	H/H	77	37117	490	4.07
ASA_WSM_1PNPDE20090406_030718_000003302077_00490_37117_4101.N1						SS1	H/H	77	37117	490	4.07
ASA_WSM_1PNPDE20090406_031027_000001412077_00490_37117_3945.N1						SS1	H/H	77	37117	490	4.07
ASA_WSM_1PNPDE20090406_031416_000001532077_00490_37117_3939.N1						SS1	V/V	77	37117	490	4.07
ASA_WSM_1PNPDE20090406_052606_000001892077_00492_37119_4116.N1						SS1	V/V	77	37119	492	4.07
ASA_WSM_1PNPDE20090406_052606_000002442077_00492_37119_4180.N1						SS1	V/V	77	37119	492	4.07
ASA_WSM_1PNPDE20090406_060740_000002252077_00492_37119_4118.N1						SS1	V/V	77	37119	492	4.07
ASA_WSM_1PNPDE20090406_091950_000001902077_00494_37121_4229.N1						SS1	V/V	77	37121	494	4.07
ASA_WSM_1PNPDE20090406_094313_000001532077_00494_37121_4286.N1						SS1	H/H	77	37121	494	4.07
ASA_WSM_1PNPDE20090406_102931_000000732077_00495_37122_4268.N1						SS1	H/H	77	37122	495	4.07
ASA_WSM_1PNPDE20090406_102931_000004902077_00495_37122_4326.N1						SS1	H/H	77	37122	495	4.07
ASA_WSM_1PNPDE20090406_103146_000001762077_00495_37122_4300.N1						SS1	H/H	77	37122	495	4.07
ASA_WSM_1PNPDE20090406_103544_000000612077_00495_37122_4280.N1						SS1	H/H	77	37122	495	4.07
ASA_WSM_1PNPDE20090406_105730_000002992077_00495_37122_4284.N1						SS1	V/V	77	37122	495	4.07
ASA_WSM_1PNPDE20090406_120826_000002452077_00496_37123_4324.N1						SS1	H/H	77	37123	496	4.07
ASA_WSM_1PNPDE20090406_121534_000000732077_00496_37123_4312.N1						SS1	H/H	77	37123	496	4.07
ASA_WSM_1PNPDE20090406_121534_000001762077_00496_37123_4347.N1						SS1	H/H	77	37123	496	4.07
ASA_WSM_1PNPDE20090406_121748_000000422077_00496_37123_4316.N1						SS1	H/H	77	37123	496	4.07
ASA_WSM_1PNPDE20090406_124552_000000732077_00496_37123_4302.N1						SS1	V/V	77	37123	496	4.07
ASA_WSM_1PNPDE20090406_124752_000000912077_00496_37123_4319.N1						SS1	V/V	77	37123	496	4.07
ASA_WSM_1PNPDE20090406_140802_000001352077_00497_37124_4405.N1						SS1	H/H	77	37124	497	4.07
ASA_WSM_1PNPDE20090406_140916_000000612077_00497_37124_4363.N1						SS1	H/H	77	37124	497	4.07
ASA_WSM_1PNPDE20090406_153255_000001532077_00498_37125_4355.N1						SS1	H/H	77	37125	498	4.07
ASA_WSM_1PNPDE20090406_154533_000001102077_00498_37125_4403.N1						SS1	H/H	77	37125	498	4.07
ASA_WSM_1PNPDE20090406_155344_000000912077_00498_37125_4397.N1						SS1	H/H	77	37125	498	4.07
ASA_WSM_1PNPDE20090406_163351_000003062077_00498_37125_4401.N1						SS1	H/H	77	37125	498	4.07
ASA_WSM_1PNPDE20090406_172436_000001352077_00499_37126_4451.N1						SS1	H/H	77	37126	499	4.07
ASA_WSM_1PNPDE20090406_172436_000003912077_00499_37126_4475.N1						SS1	H/H	77	37126	499	4.07
ASA_WSM_1PNPDE20090406_172847_000001392077_00499_37126_4452.N1						SS1	H/H	77	37126	499	4.07
ASA_WSM_1PNPDE20090406_183354_000000912077_00499_37126_4447.N1						SS1	H/H	77	37126	499	4.07
ASA_WSM_1PNPDE20090406_195002_000000612077_00500_37127_4471.N1						SS1	H/H	77	37127	500	4.07
ASA_WSM_1PNPDE20090406_200810_000001532077_00500_37127_4483.N1						SS1	V/V	77	37127	500	4.07
ASA_WSM_1PNPDE20090406_201120_000001902077_00500_37127_4485.N1						SS1	H/H	77	37127	500	4.07




Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20090405_235434_000003742077_00488_37115_3391.N1						IS2	V/V	77	37115	488	4.07
ASA_WVS_1PNPDE20090405_235949_000016192077_00488_37115_3521.N1						IS2	V/V	77	37115	488	4.07
ASA_WVS_1PNPDE20090405_235434_000003742077_00488_37115_3391.N1						IS1	V/V	77	37115	488	4.07
ASA_WVS_1PNPDE20090406_004836_000010092077_00489_37116_3528.N1						IS2	V/V	77	37116	489	4.07
ASA_WVS_1PNPDE20090406_011202_000003752077_00489_37116_3531.N1						IS2	V/V	77	37116	489	4.07
ASA_WVS_1PNPDE20090406_013510_000002402077_00489_37116_3536.N1						IS2	V/V	77	37116	489	4.07
ASA_WVS_1PNPDE20090406_013825_000002852077_00489_37116_3659.N1						IS2	V/V	77	37116	489	4.07
ASA_WVS_1PNPDE20090406_015403_000005992077_00490_37117_3670.N1						IS2	V/V	77	37117	490	4.07
ASA_WVS_1PNPDE20090406_024049_000009742077_00490_37117_3673.N1						IS2	V/V	77	37117	490	4.07
ASA_WVS_1PNPDE20090406_025649_000001352077_00490_37117_3834.N1						IS2	V/V	77	37117	490	4.07
ASA_WVS_1PNPDE20090406_032520_000001042077_00490_37117_3827.N1						IS2	V/V	77	37117	490	4.07
ASA_WVS_1PNPDE20090406_033320_000000892077_00491_37118_3816.N1						IS2	V/V	77	37118	491	4.07
ASA_WVS_1PNPDE20090406_033710_000001942077_00491_37118_3811.N1						IS2	V/V	77	37118	491	4.07
ASA_WVS_1PNPDE20090406_041843_000008992077_00491_37118_3854.N1						IS2	V/V	77	37118	491	4.07
ASA_WVS_1PNPDE20090406_043328_000001502077_00491_37118_3989.N1						IS2	V/V	77	37118	491	4.07
ASA_WVS_1PNPDE20090406_043801_000000902077_00491_37118_3986.N1						IS2	V/V	77	37118	491	4.07
ASA_WVS_1PNPDE20090406_045622_000013792077_00491_37118_4020.N1						IS2	V/V	77	37118	491	4.07
ASA_WVS_1PNPDE20090406_055831_000003142077_00492_37119_4015.N1						IS2	V/V	77	37119	492	4.07
ASA_WVS_1PNPDE20090406_061128_000001952077_00492_37119_4012.N1						IS2	V/V	77	37119	492	4.07
ASA_WVS_1PNPDK20090406_061428_000003452077_00492_37119_2608.N1						IS2	V/V	77	37119	492	4.07
ASA_WVS_1PNPDK20090406_063658_000019792077_00492_37119_2642.N1						IS2	V/V	77	37119	492	4.07
ASA_WVS_1PNPDK20090406_092410_000010342077_00494_37121_2774.N1						IS2	V/V	77	37121	494	4.07
ASA_WVS_1PNPDK20090406_095810_000018442077_00494_37121_2848.N1						IS2	V/V	77	37121	494	4.07
ASA_WVS_1PNPDK20090406_104735_000000902077_00495_37122_2950.N1						IS2	V/V	77	37122	495	4.07
ASA_WVS_1PNPDK20090406_105519_000000892077_00495_37122_2953.N1						IS2	V/V	77	37122	495	4.07
ASA_WVS_1PNPDK20090406_110227_000011692077_00495_37122_2958.N1						IS2	V/V	77	37122	495	4.07
ASA_WVS_1PNPDK20090406_113845_000001652077_00495_37122_2961.N1						IS2	V/V	77	37122	495	4.07
ASA_WVS_1PNPDK20090406_114313_000014692077_00495_37122_2976.N1						IS2	V/V	77	37122	495	4.07
ASA_WVS_1PNPDK20090406_122949_000009142077_00496_37123_3087.N1						IS2	V/V	77	37123	496	4.07
ASA_WVS_1PNPDK20090406_125730_000001652077_00496_37123_3090.N1						IS2	V/V	77	37123	496	4.07
ASA_WVS_1PNPDK20090406_131921_000003002077_00496_37123_3095.N1						IS2	V/V	77	37123	496	4.07
ASA_WVS_1PNPDK20090406_133258_000006452077_00496_37123_3100.N1						IS2	V/V	77	37123	496	4.07
ASA_WVS_1PNPDK20090406_141458_000004792077_00497_37124_3213.N1						IS2	V/V	77	37124	497	4.07
ASA_WVS_1PNPDK20090406_143141_000006902077_00497_37124_3220.N1						IS2	V/V	77	37124	497	4.07
ASA_WVS_1PNPDK20090406_145957_000011242077_00497_37124_3229.N1						IS2	V/V	77	37124	497	4.07
ASA_WVS_1PNPDK20090406_155922_000000742077_00498_37125_3341.N1						IS2	V/V	77	37125	498	4.07
ASA_WVS_1PNPDK20090406_160324_000012142077_00498_37125_3348.N1						IS2	V/V	77	37125	498	4.07
ASA_WVS_1PNPDK20090406_164033_000011092077_00498_37125_3357.N1						IS2	V/V	77	37125	498	4.07
ASA_WVS_1PNPDK20090406_174053_000014092077_00499_37126_3469.N1						IS2	V/V	77	37126	499	4.07
ASA_WVS_1PNPDK20090406_182527_000004642077_00499_37126_3466.N1						IS2	V/V	77	37126	499	4.07
ASA_WVS_1PNPDK20090406_191351_000018592077_00500_37127_3583.N1						IS2	V/V	77	37127	500	4.07
ASA_WVS_1PNPDK20090406_200145_000003452077_00500_37127_3588.N1						IS2	V/V	77	37127	500	4.07
ASA_WVS_1PNPDE20090406_214221_000001952077_00501_37128_4496.N1						IS2	V/V	77	37128	501	4.07
ASA_WVS_1PNPDK20090406_214451_000001202077_00501_37128_3695.N1						IS2	V/V	77	37128	501	4.07
ASA_WVS_1PNPDK20090406_215359_000003742077_00501_37128_3698.N1						IS2	V/V	77	37128	501	4.07
ASA_WVS_1PNPDK20090406_221348_000000602078_00001_37129_3701.N1						IS2	V/V	78	37129	1	4.07



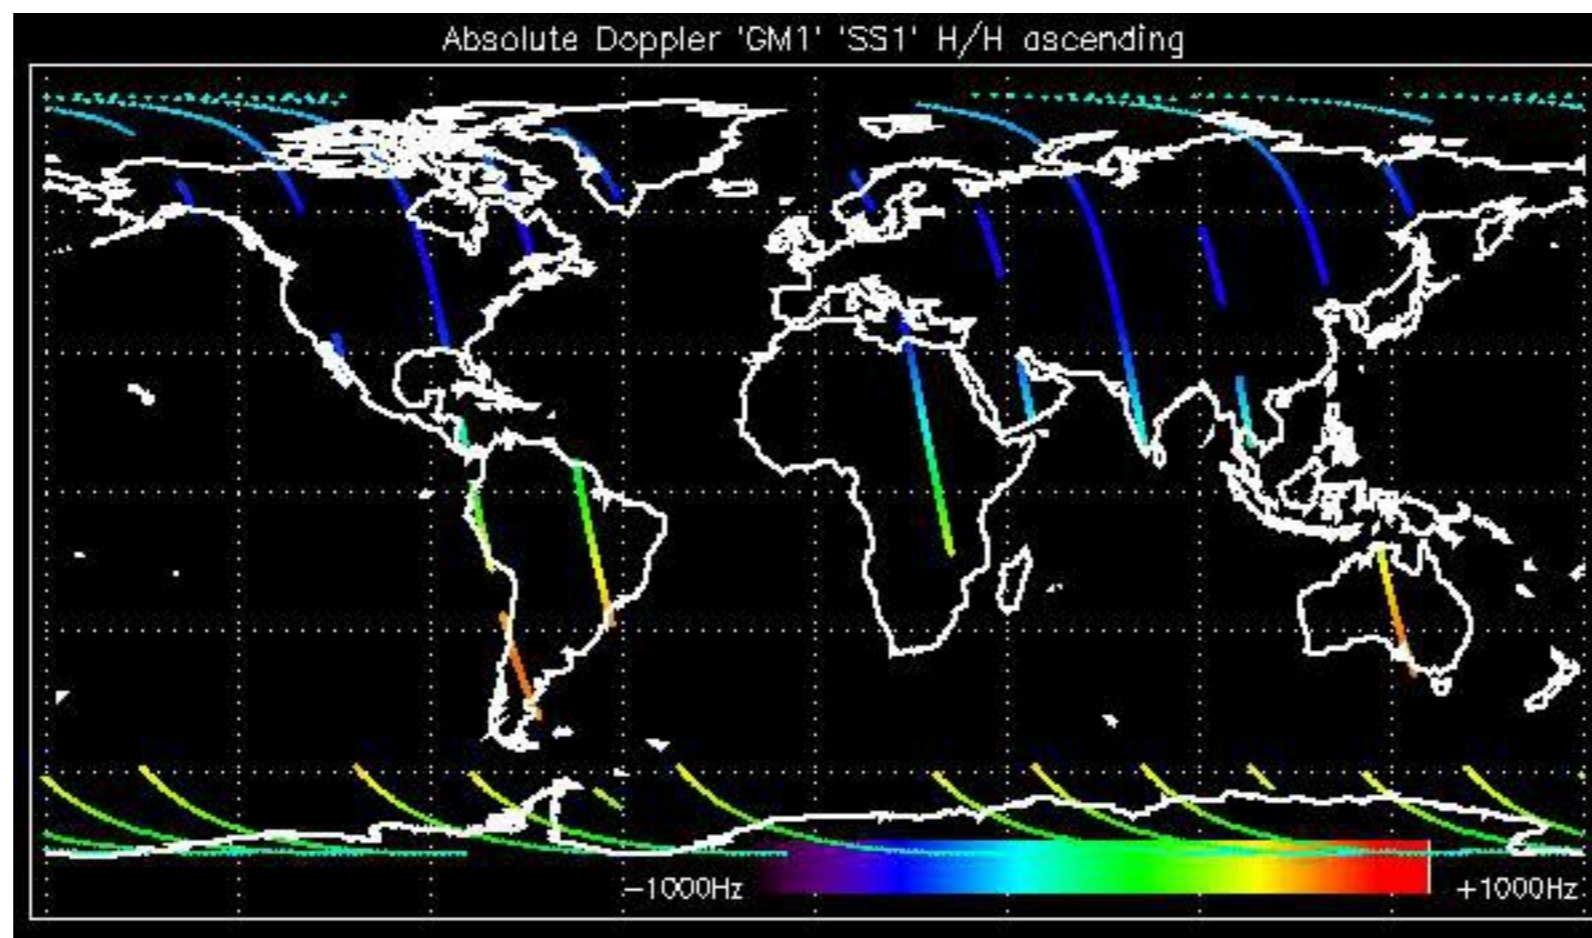


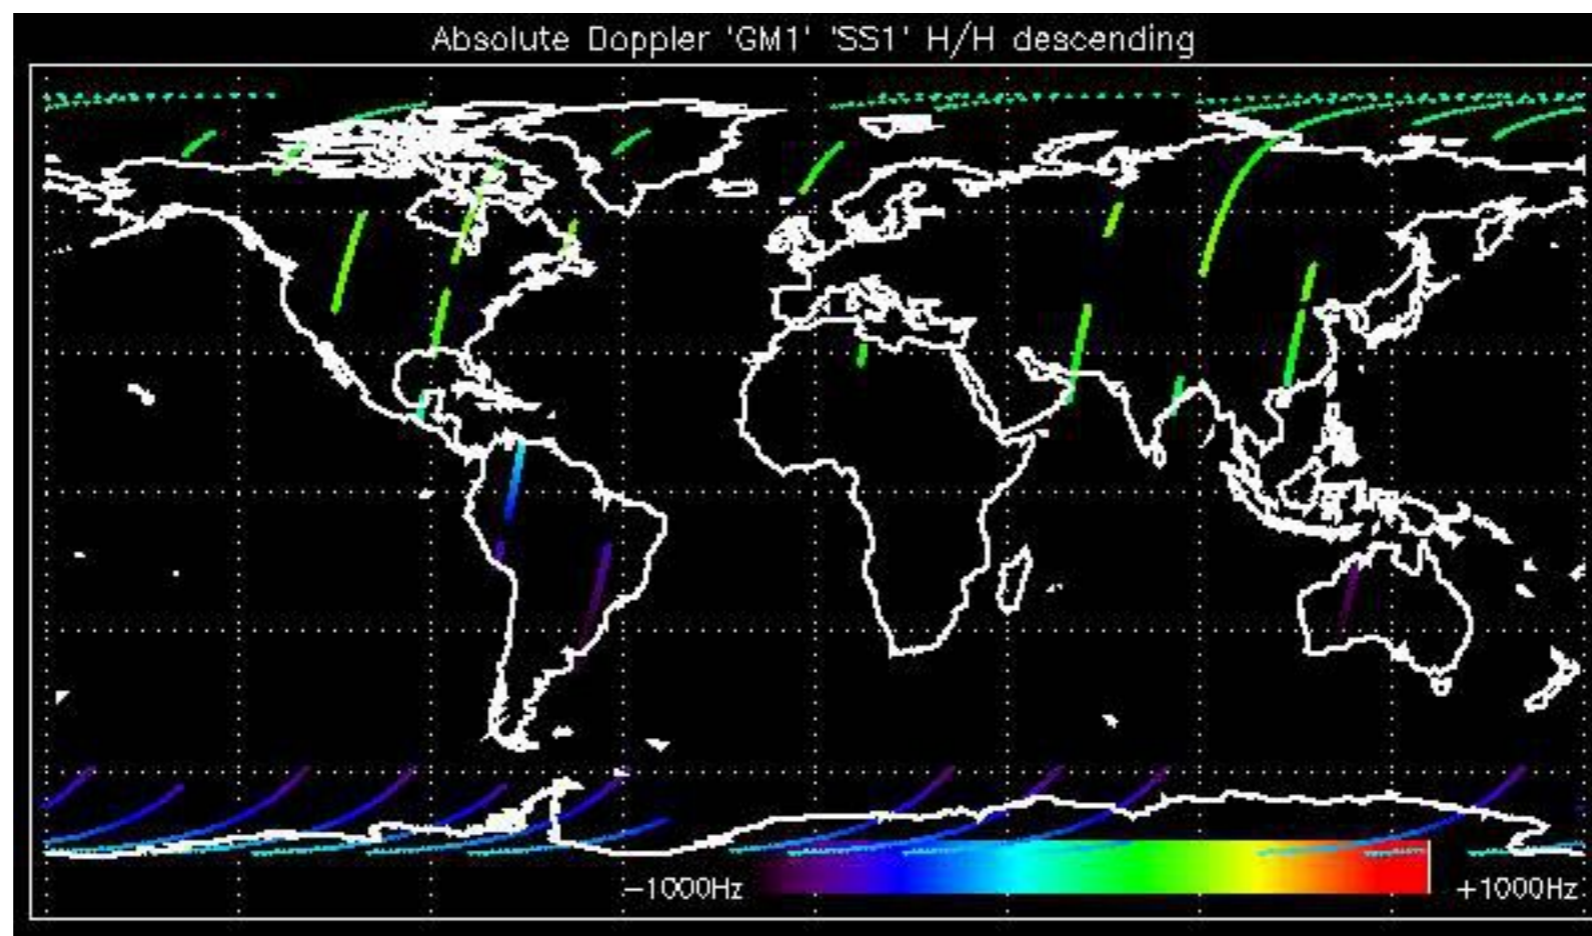


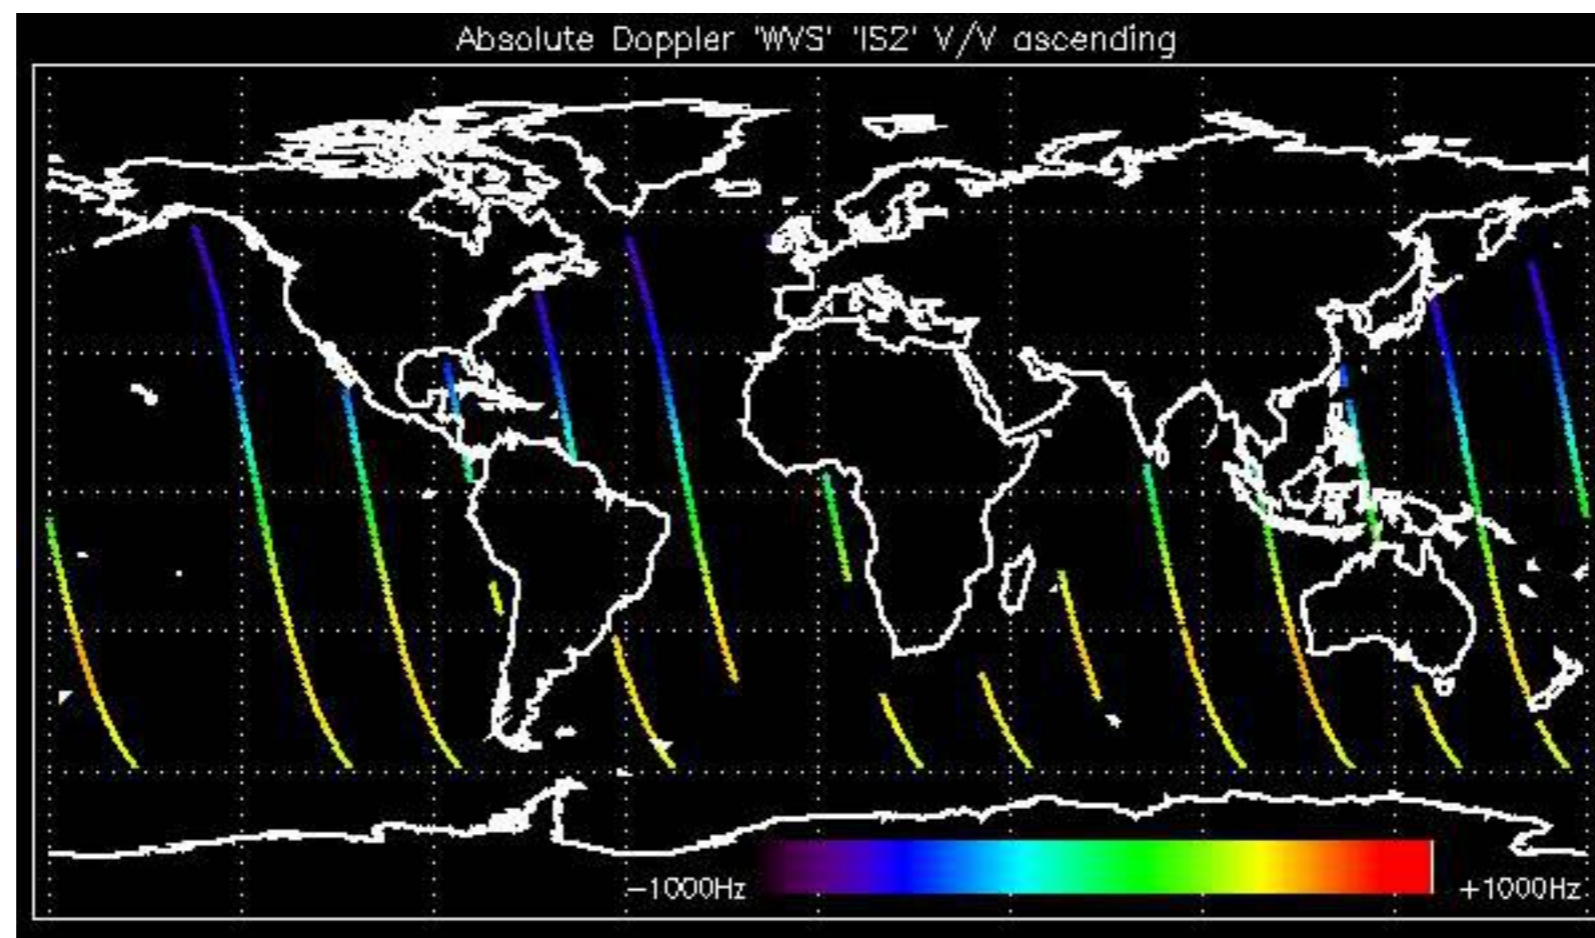


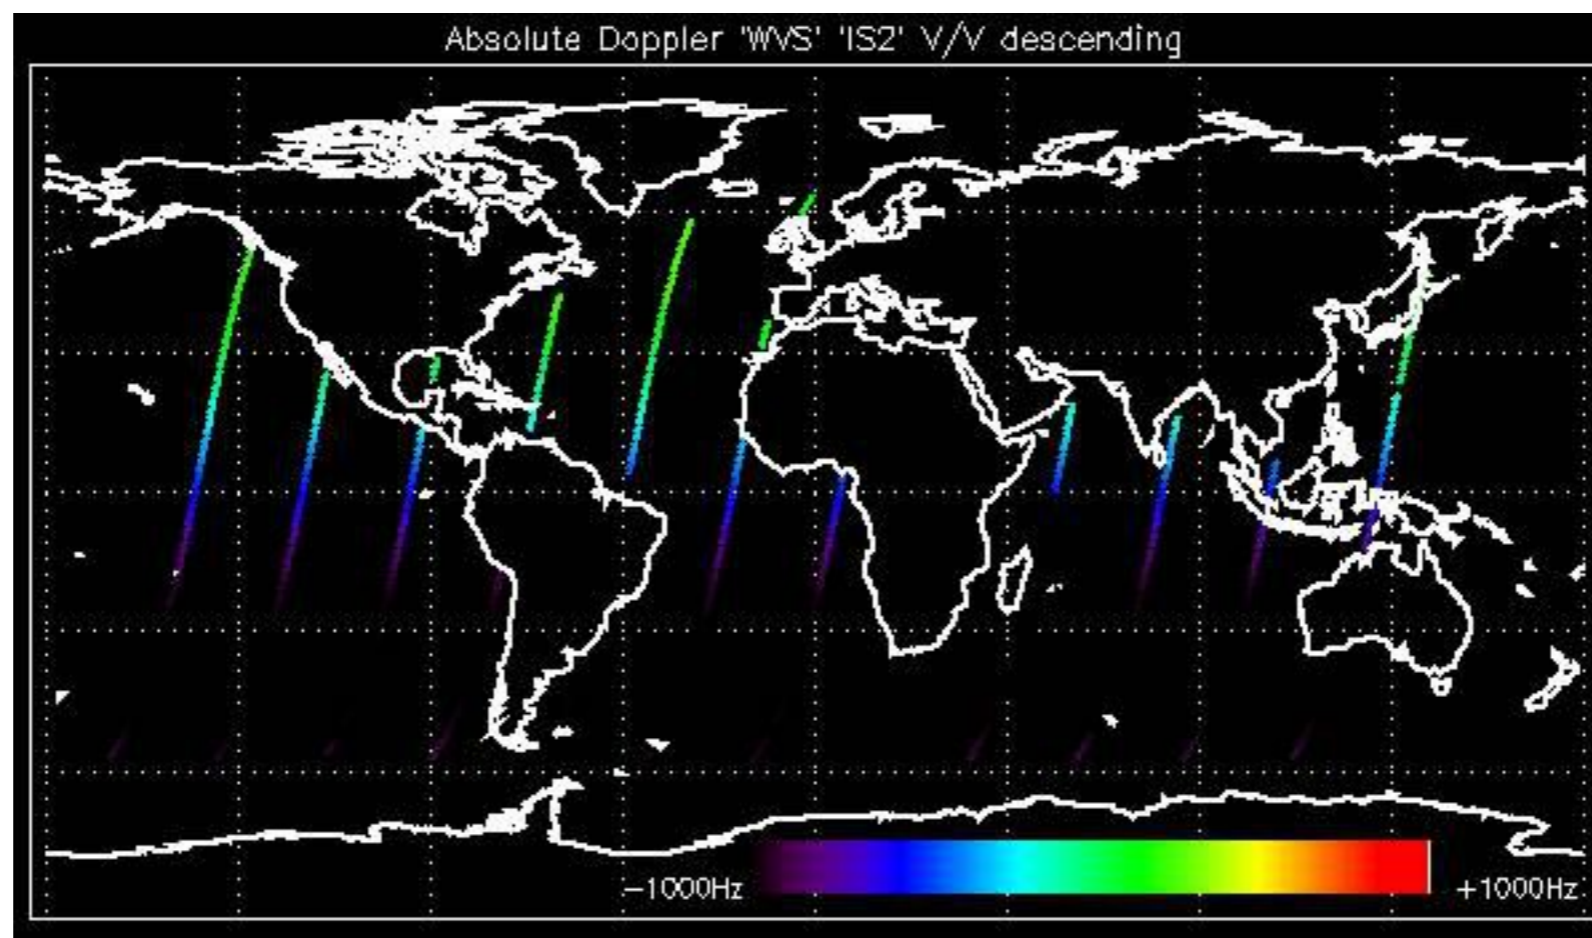


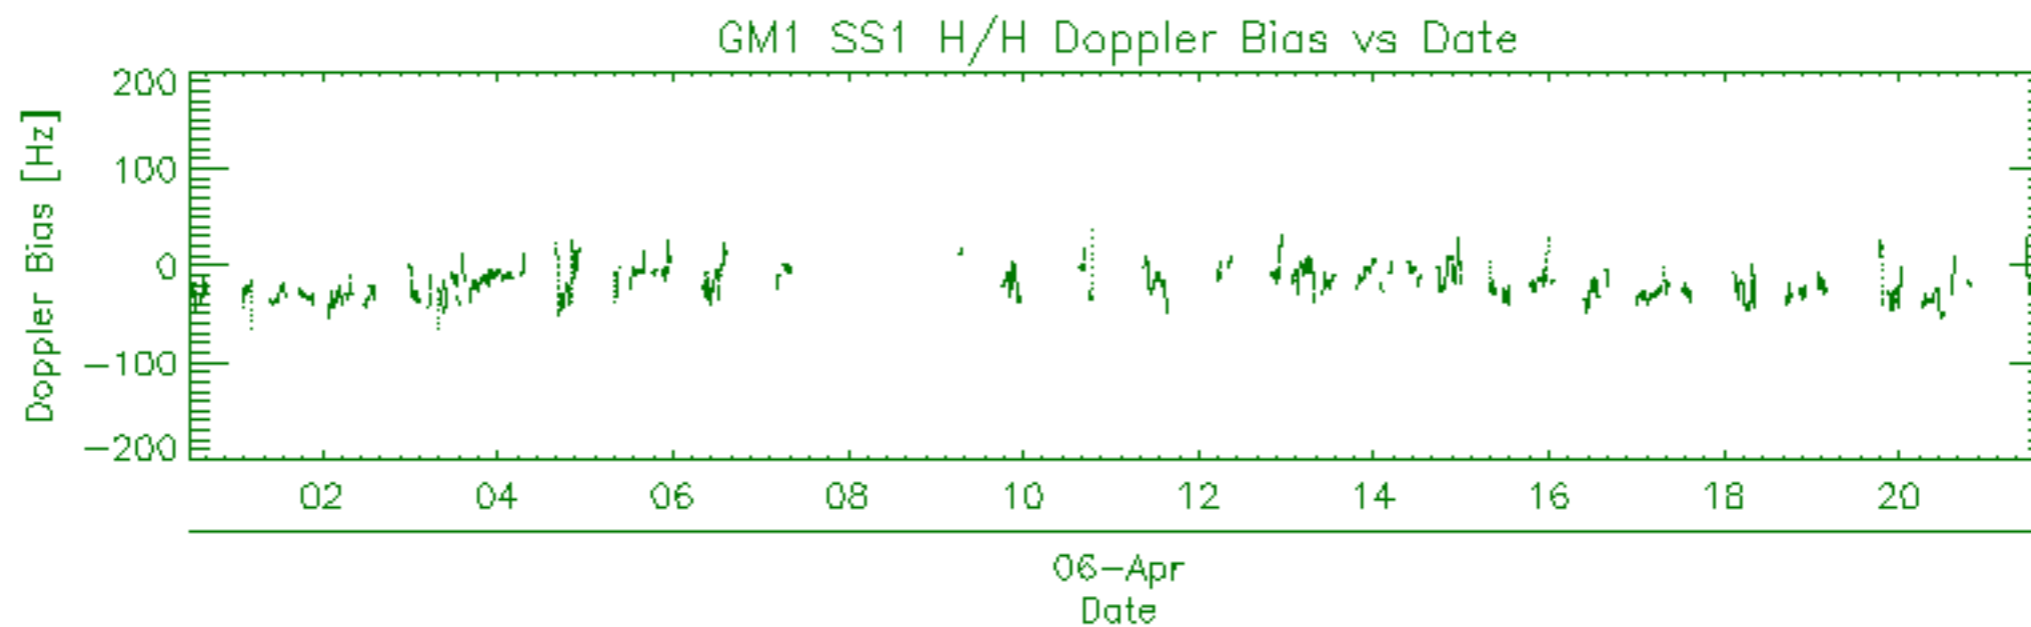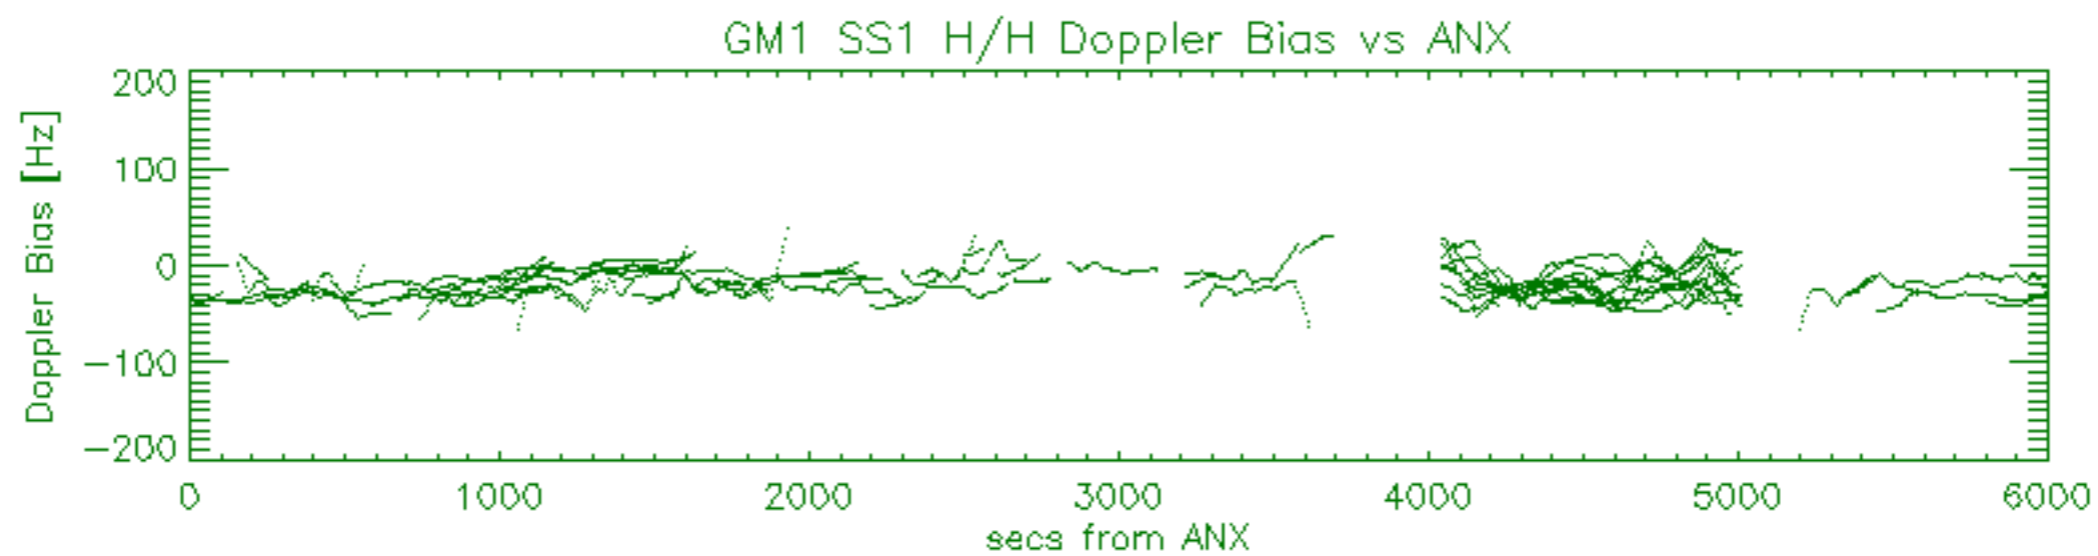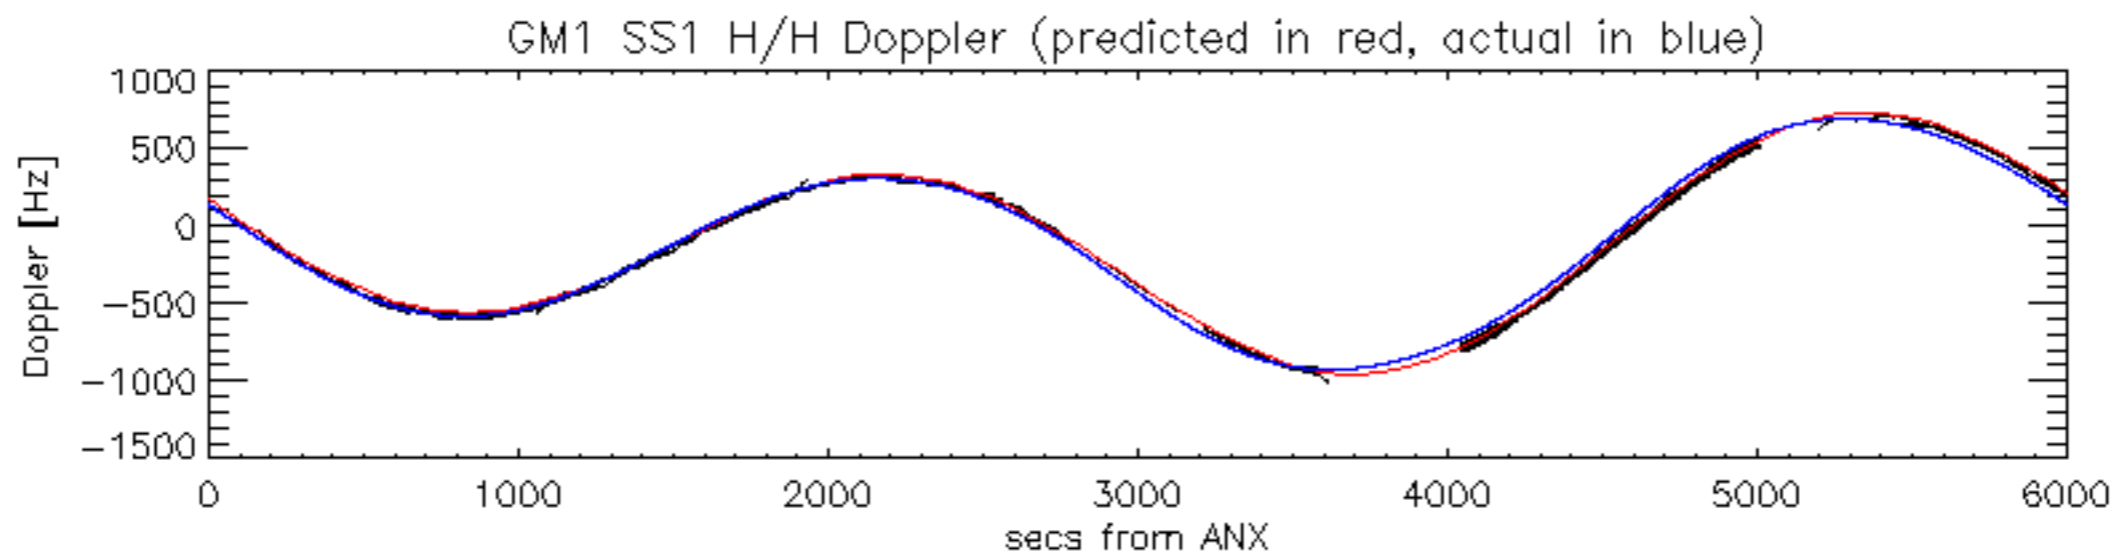



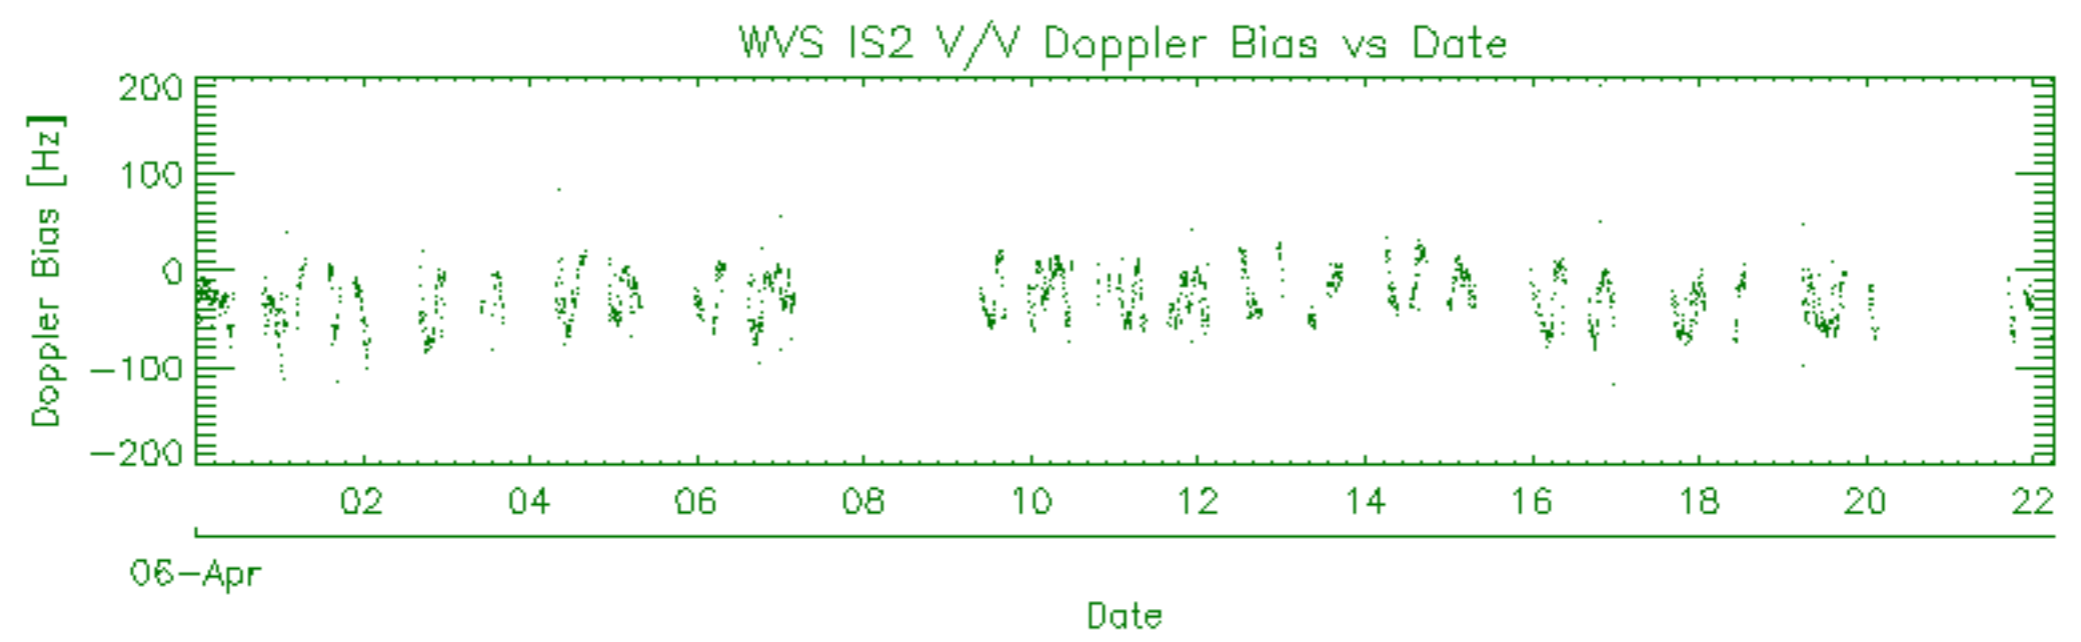
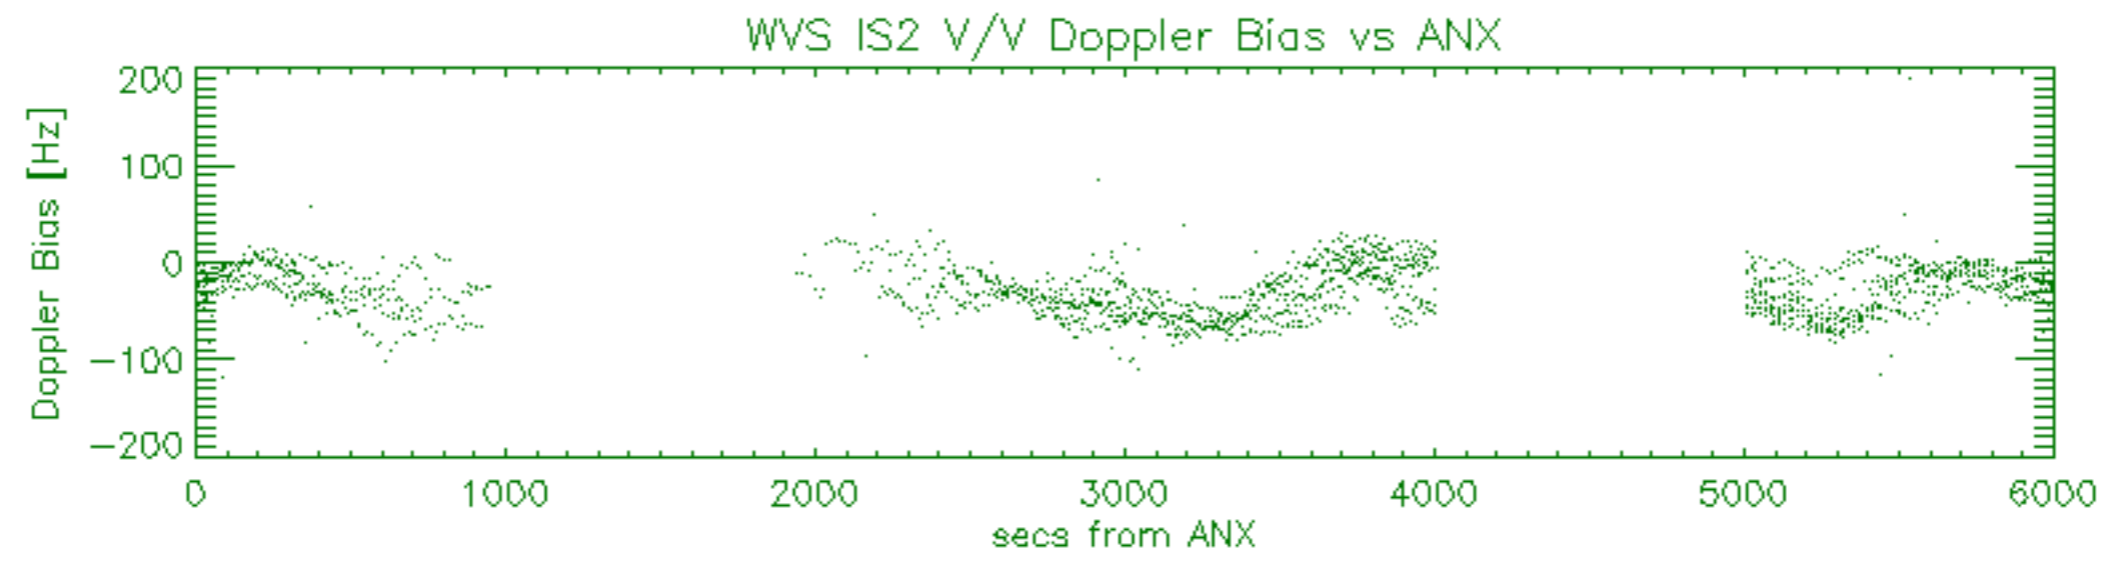
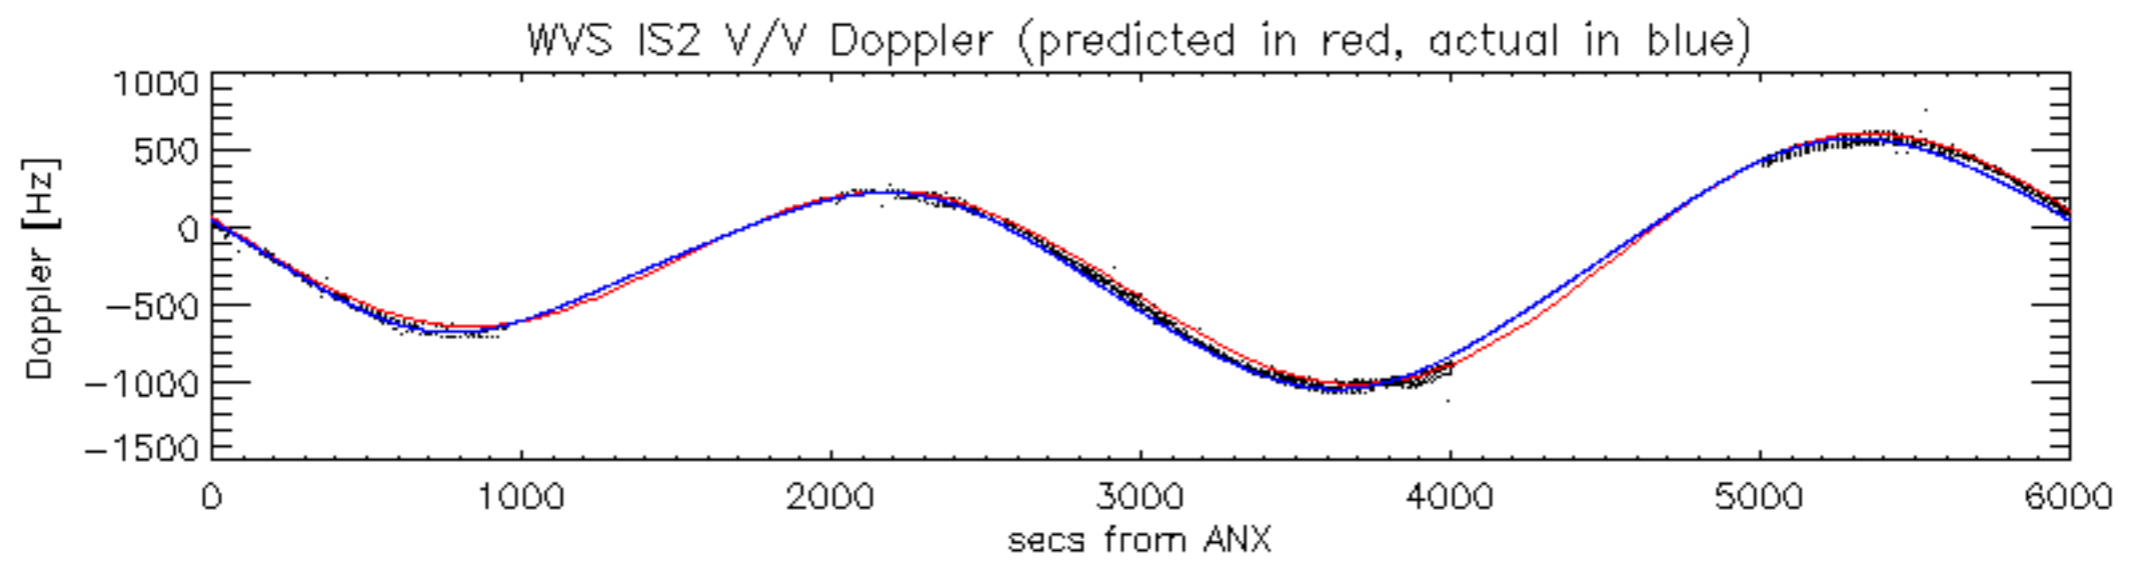


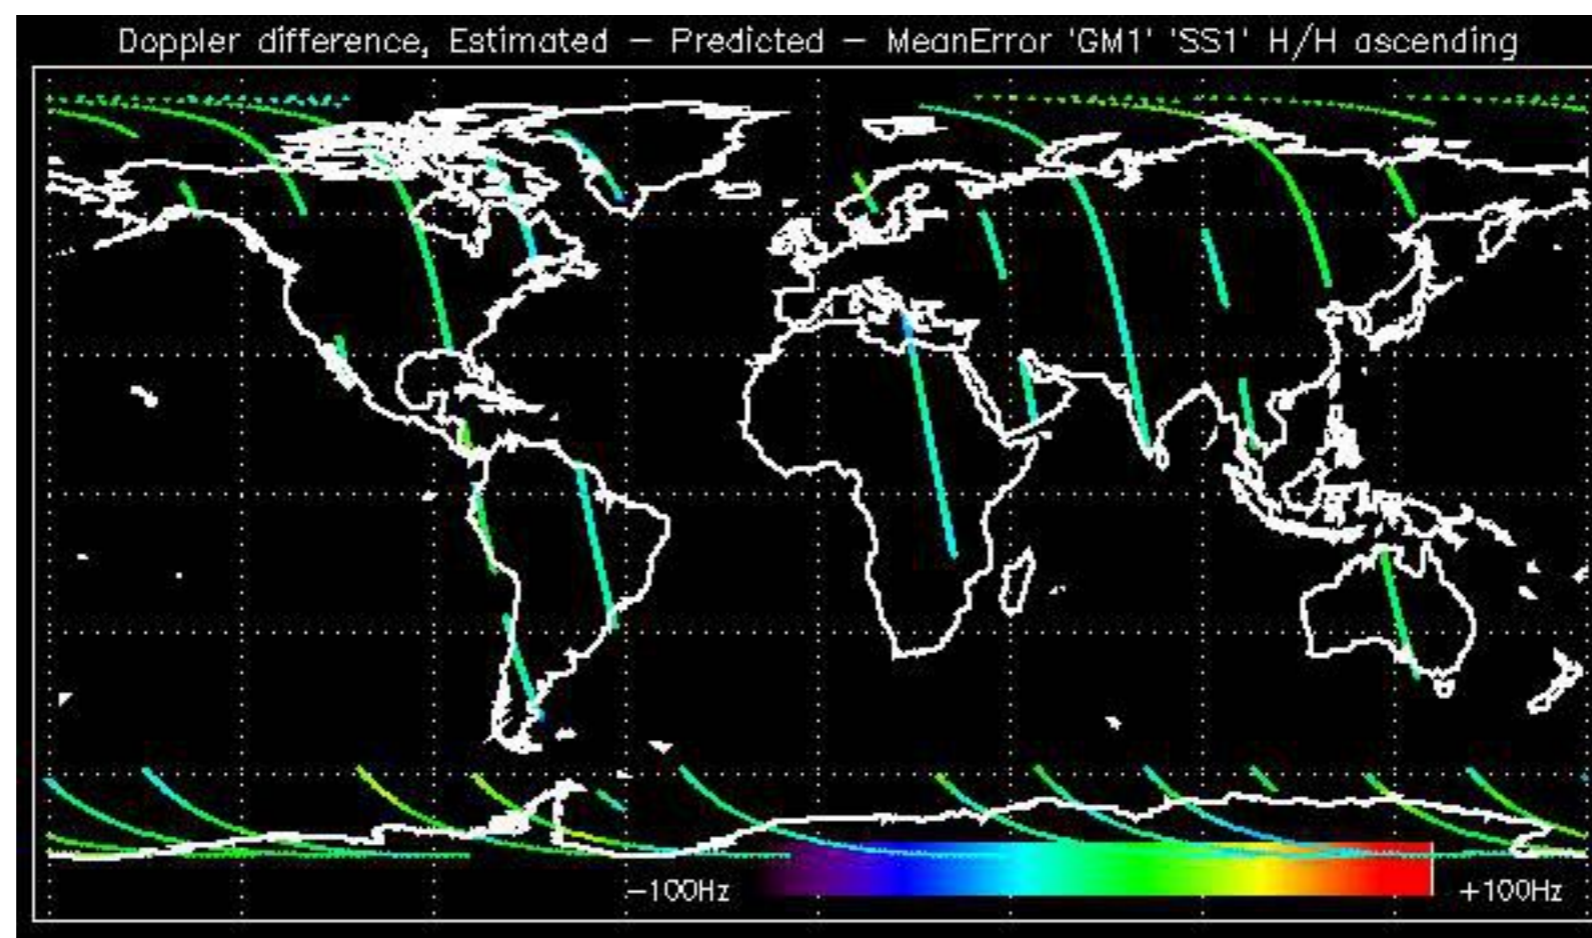


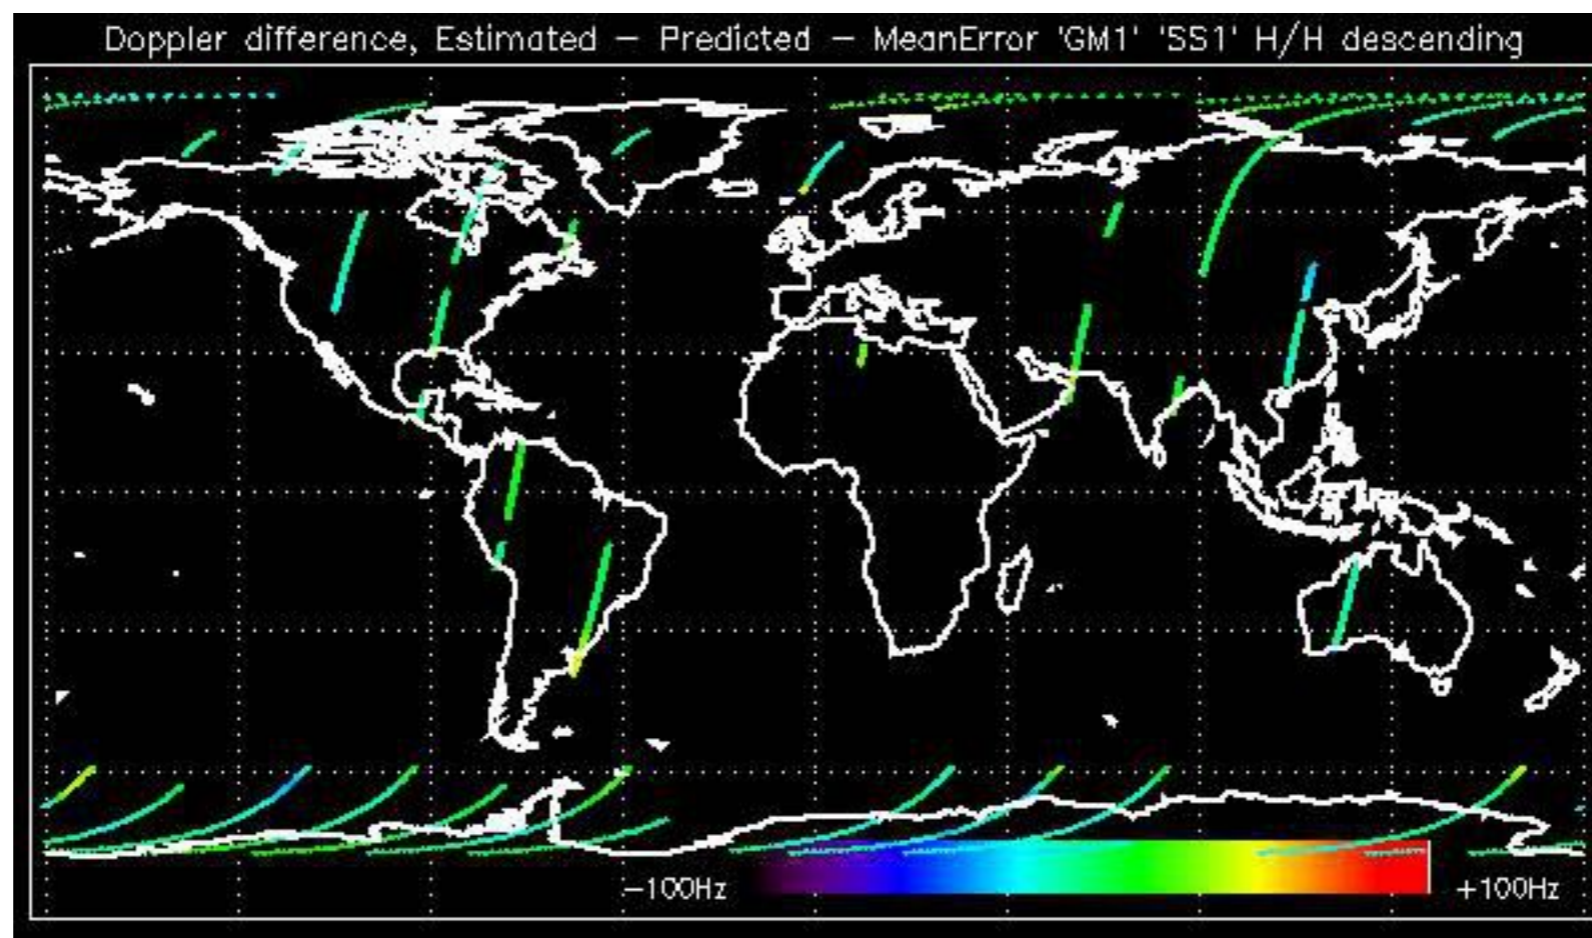




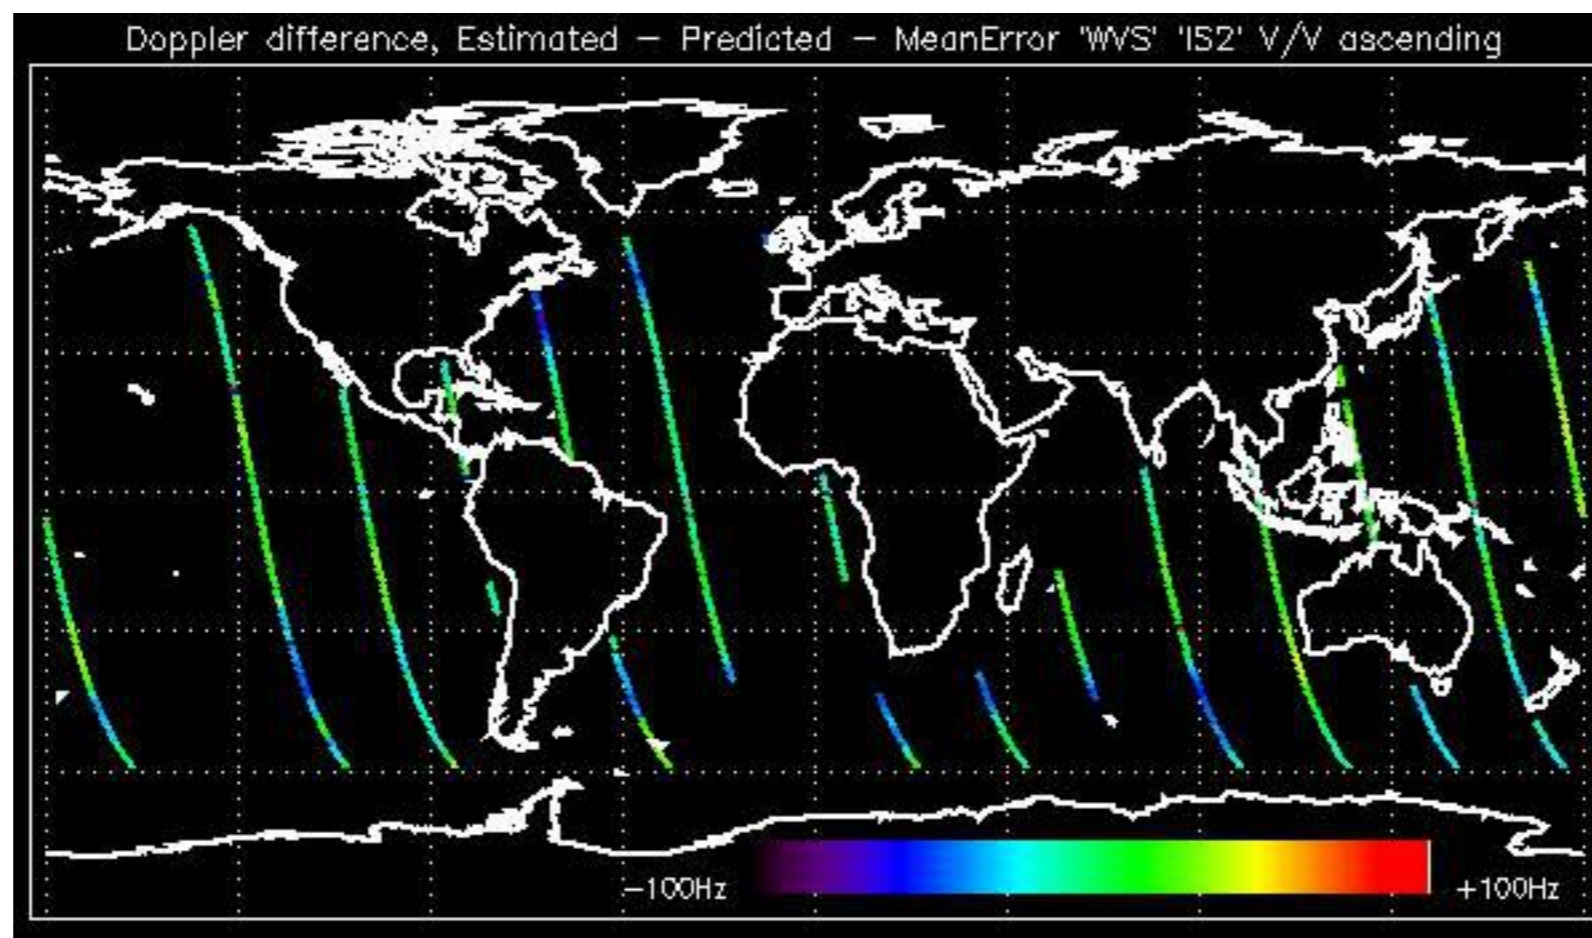




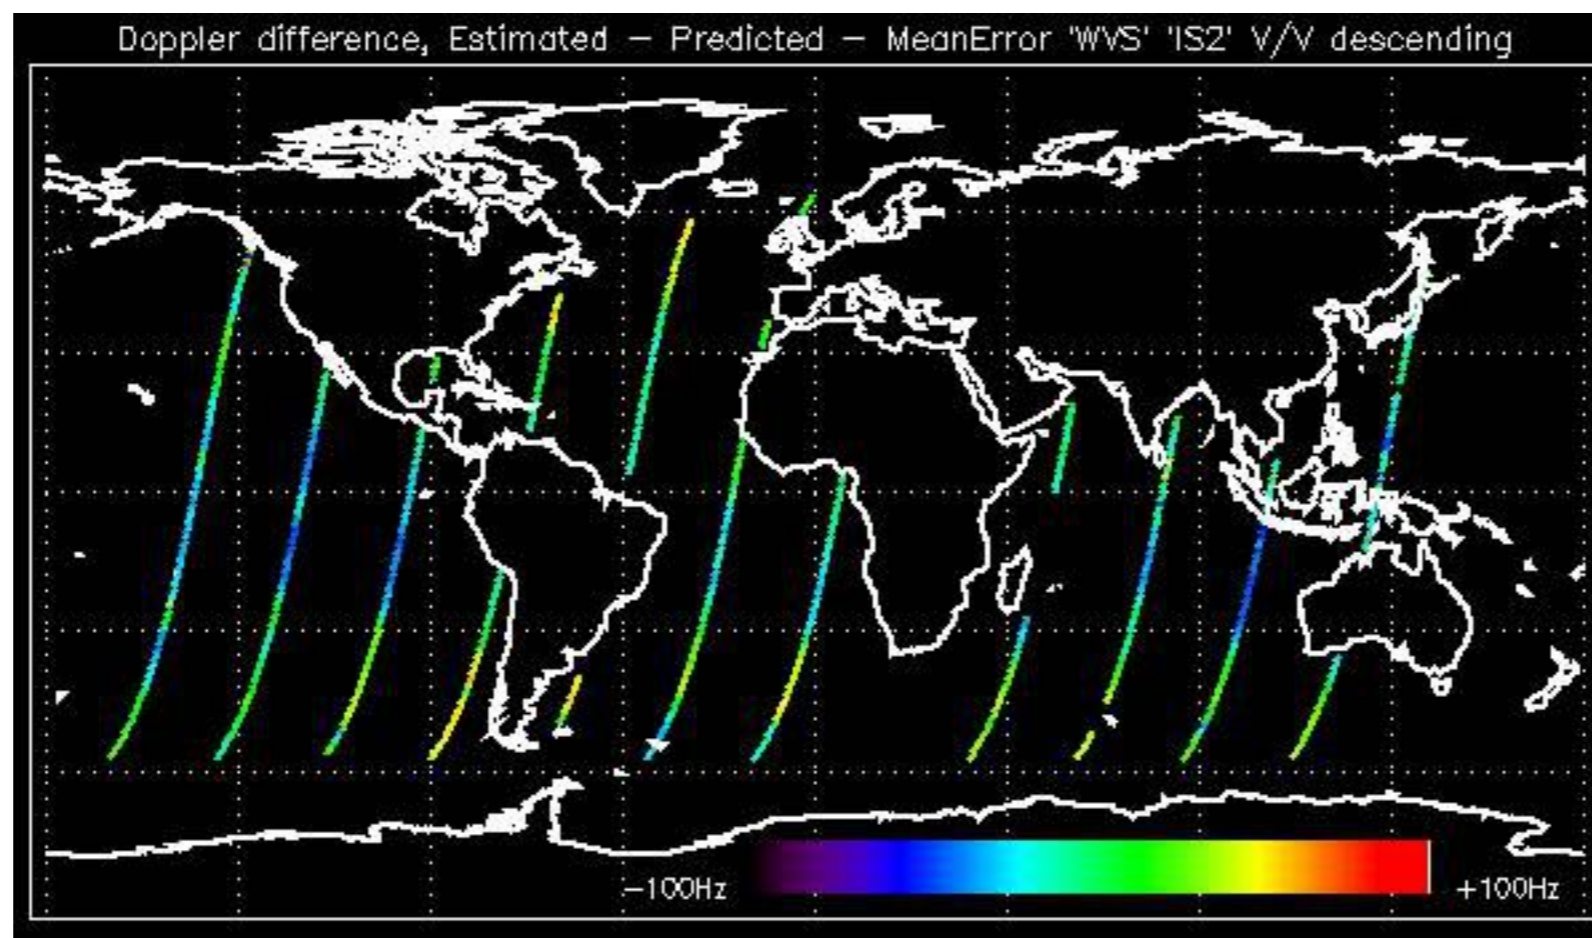


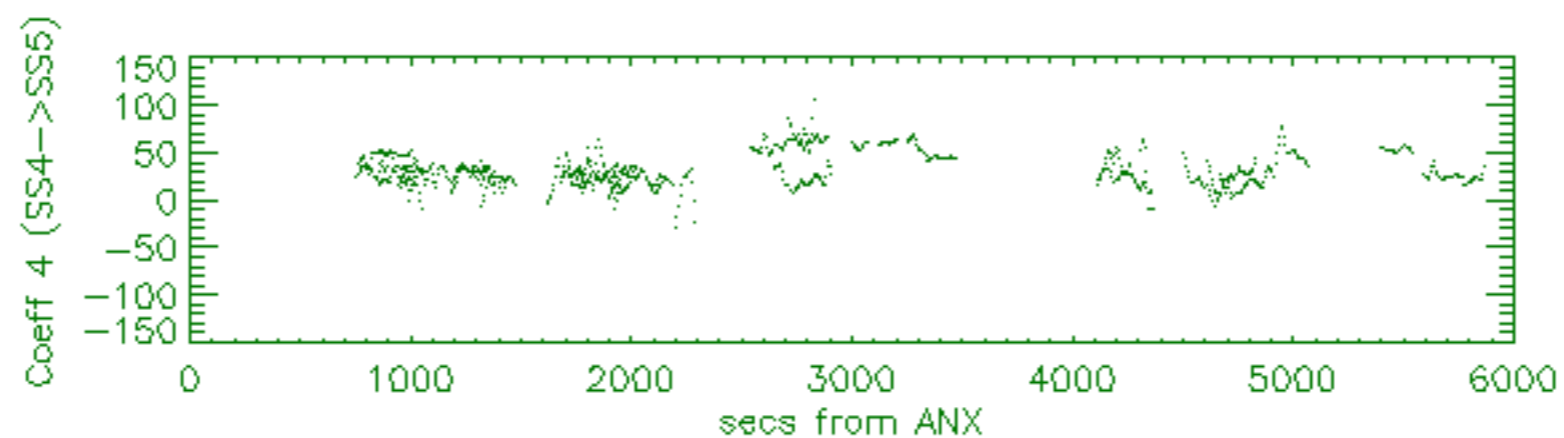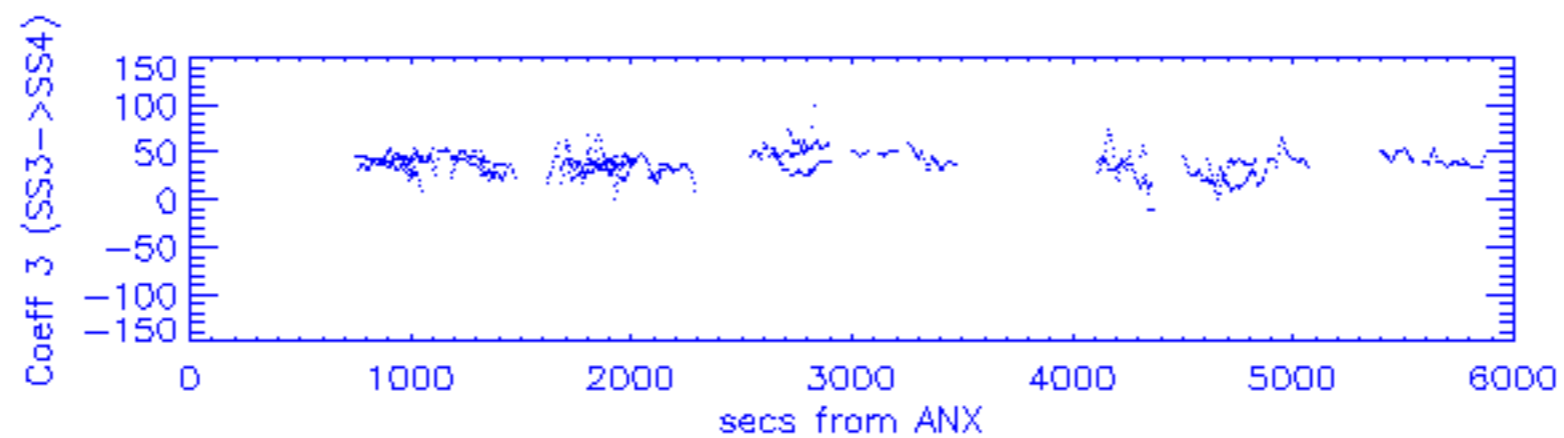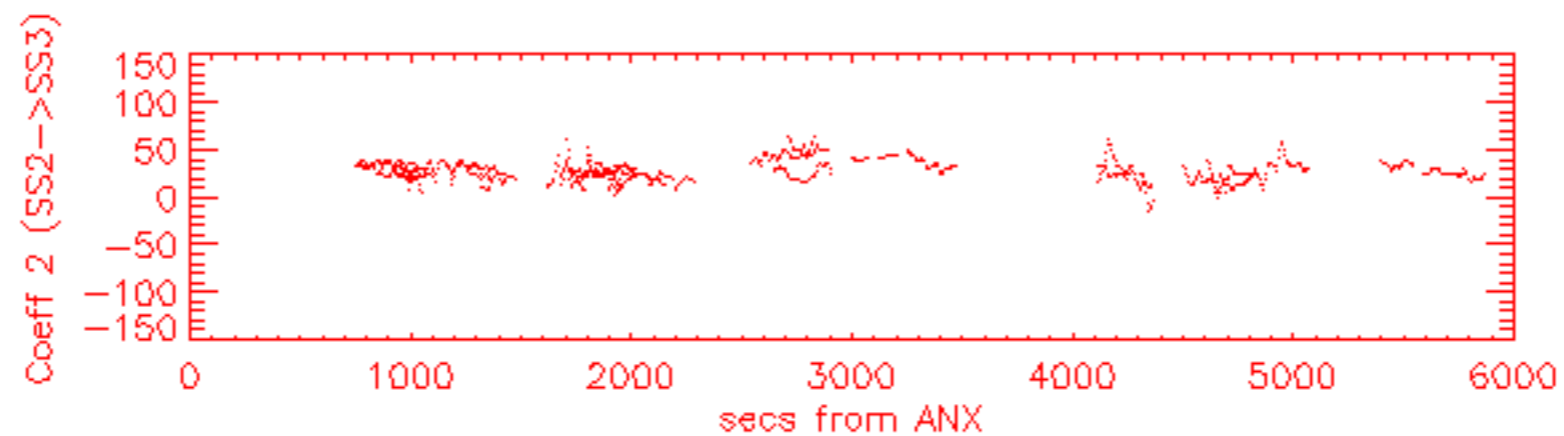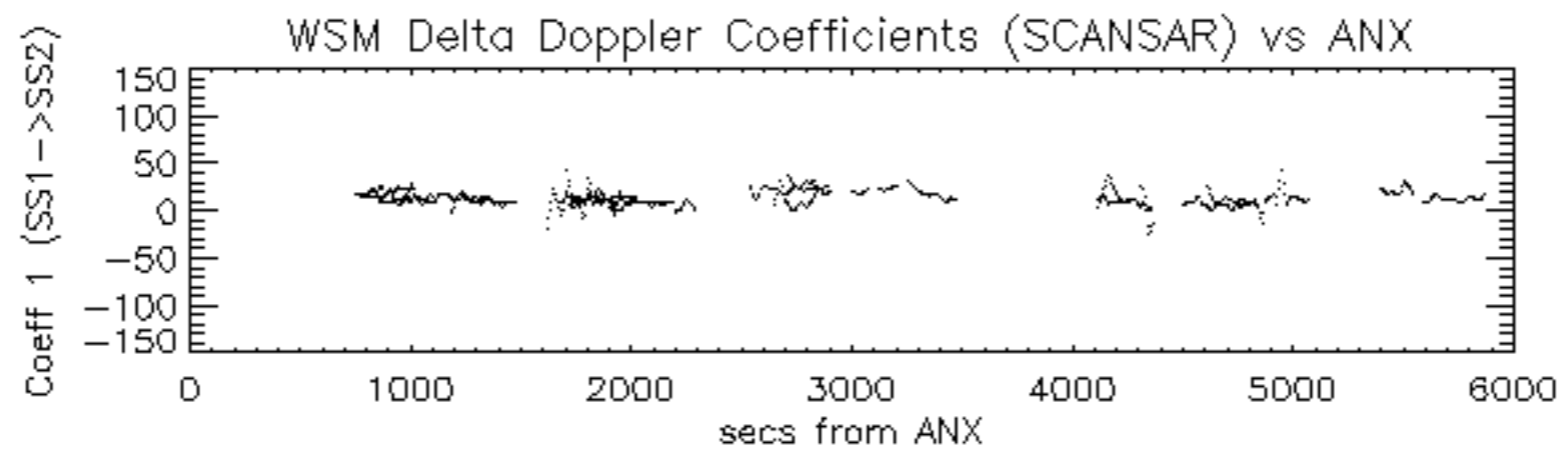


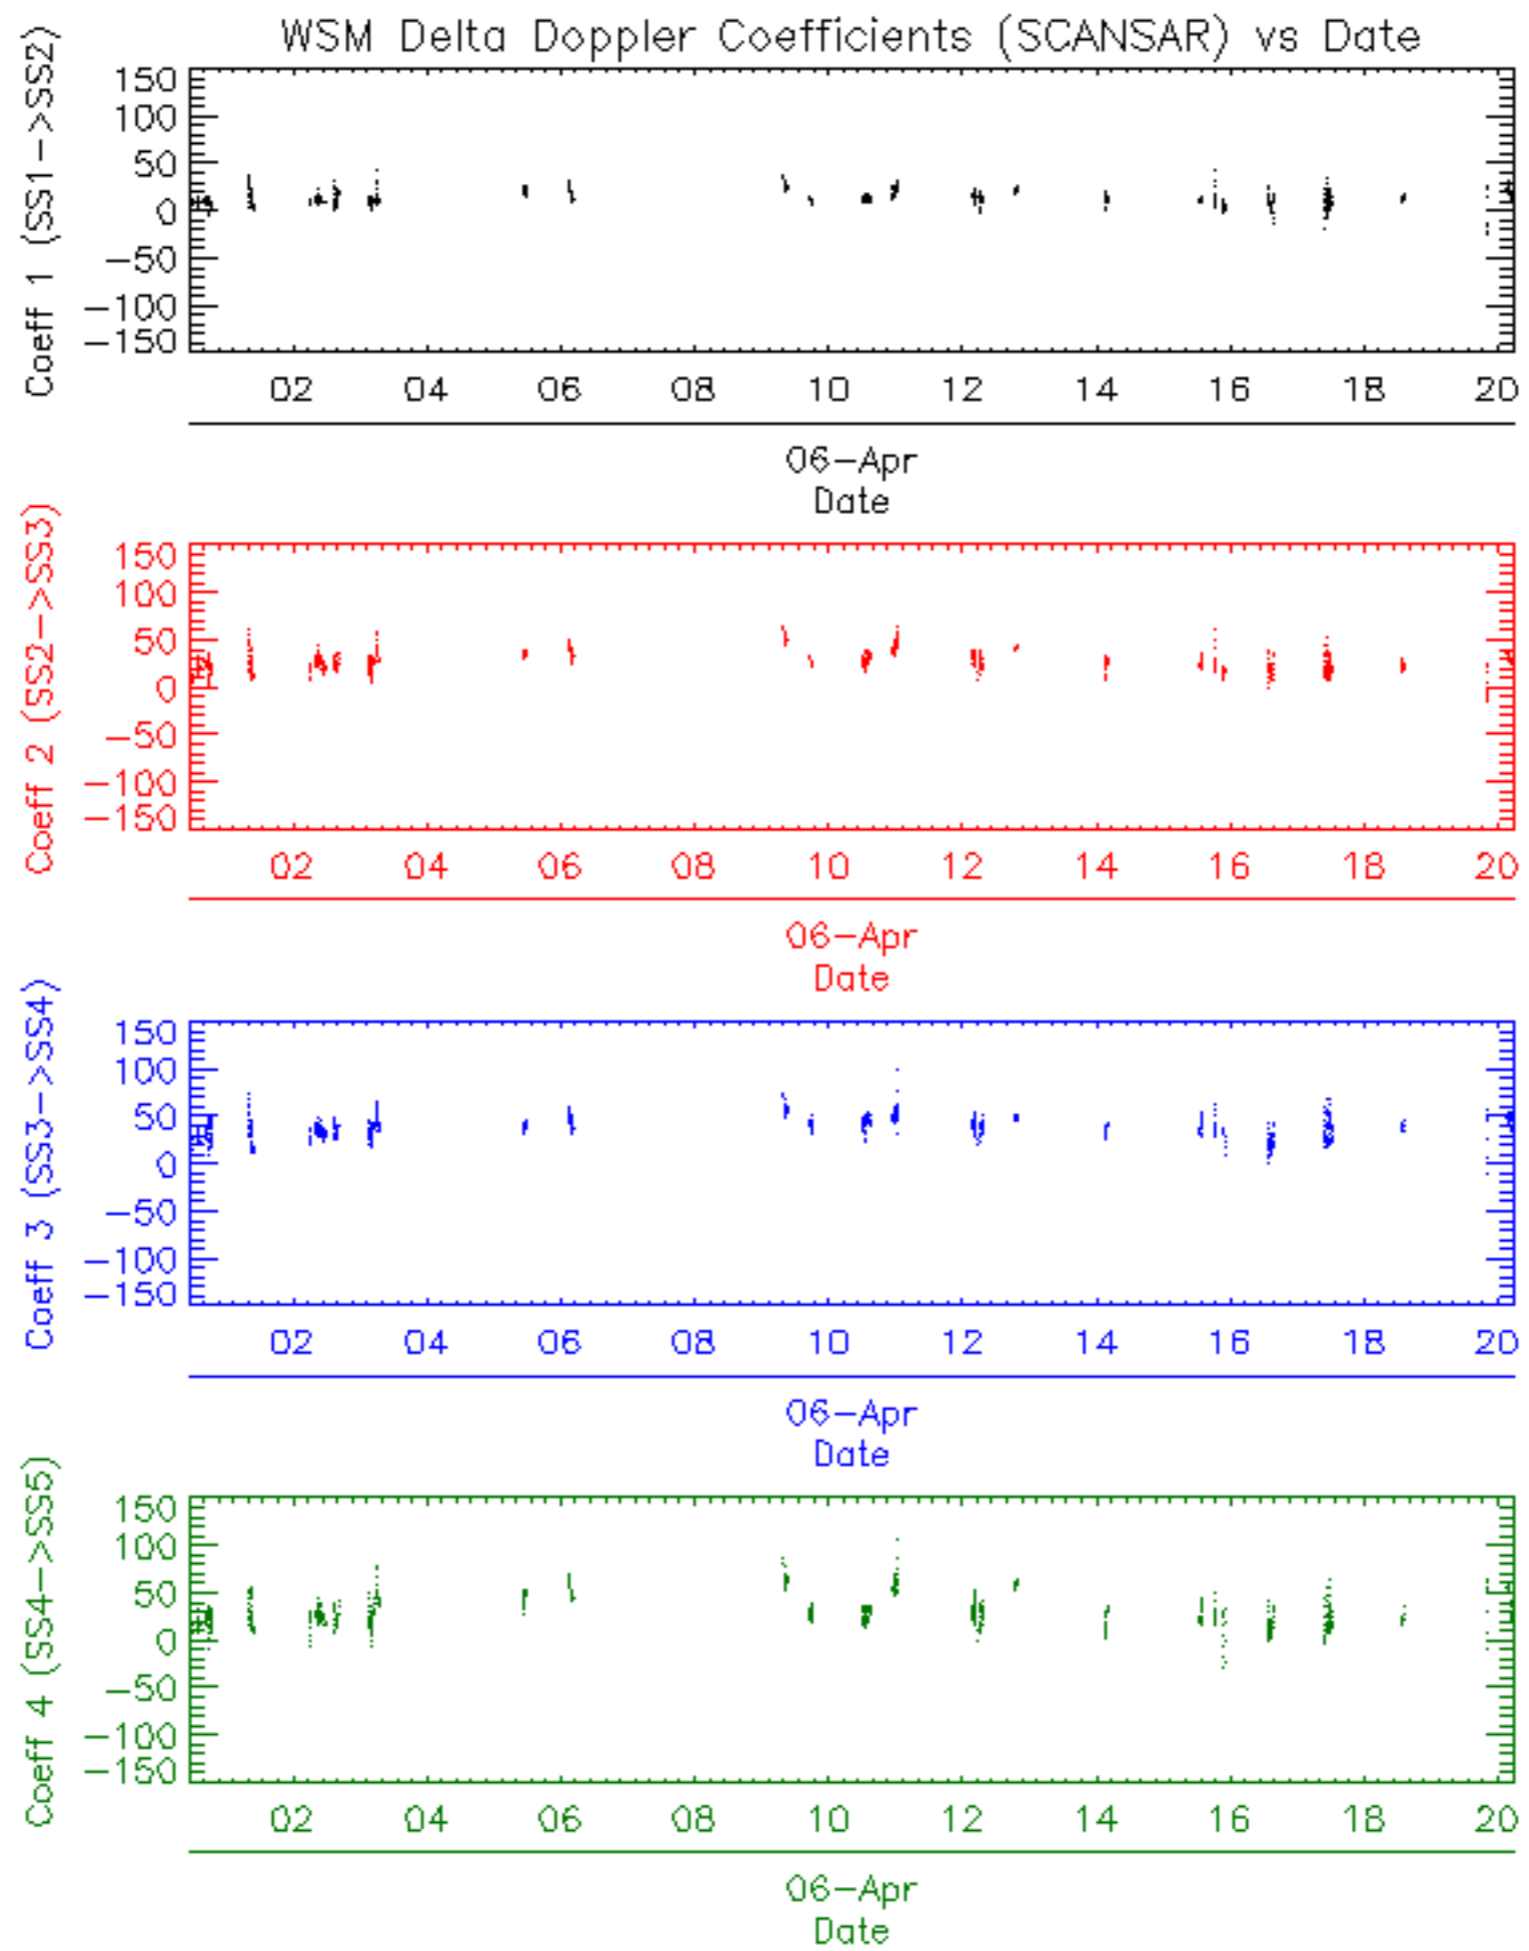


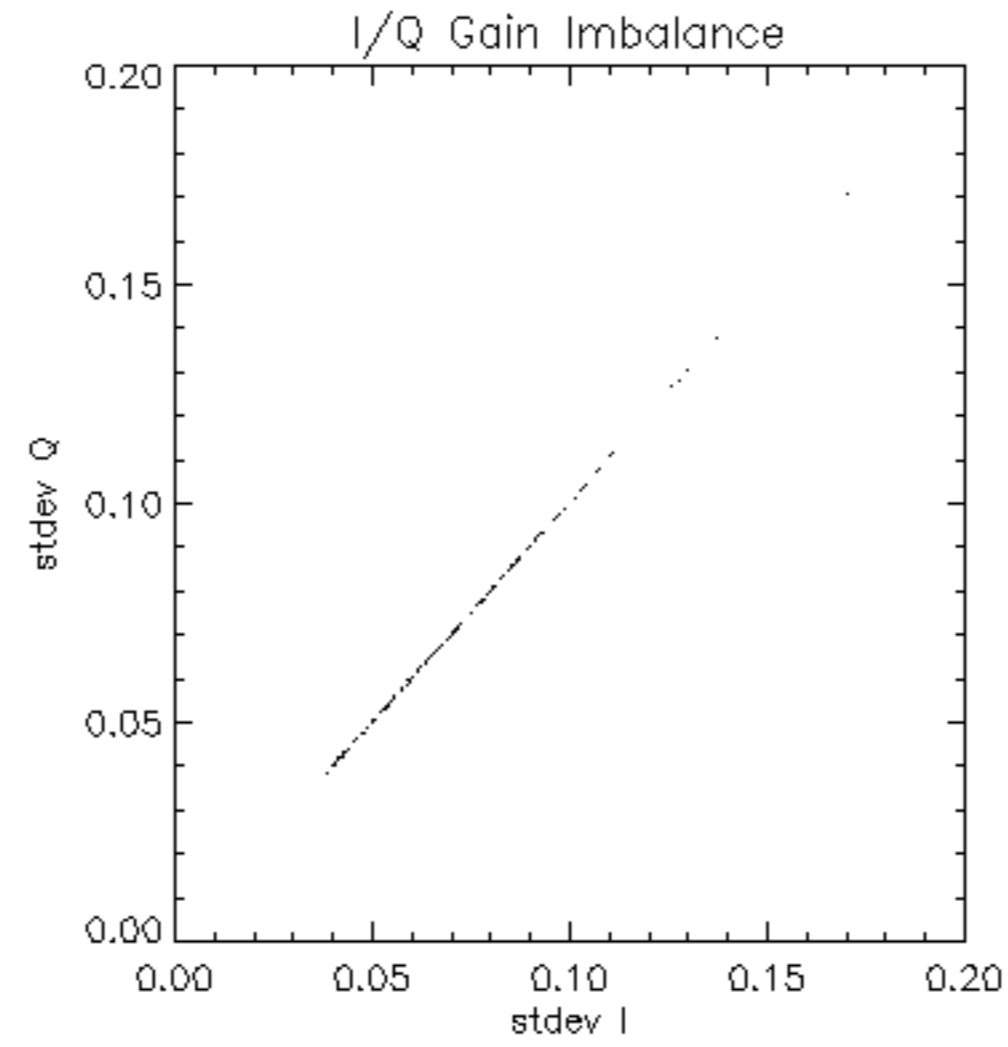

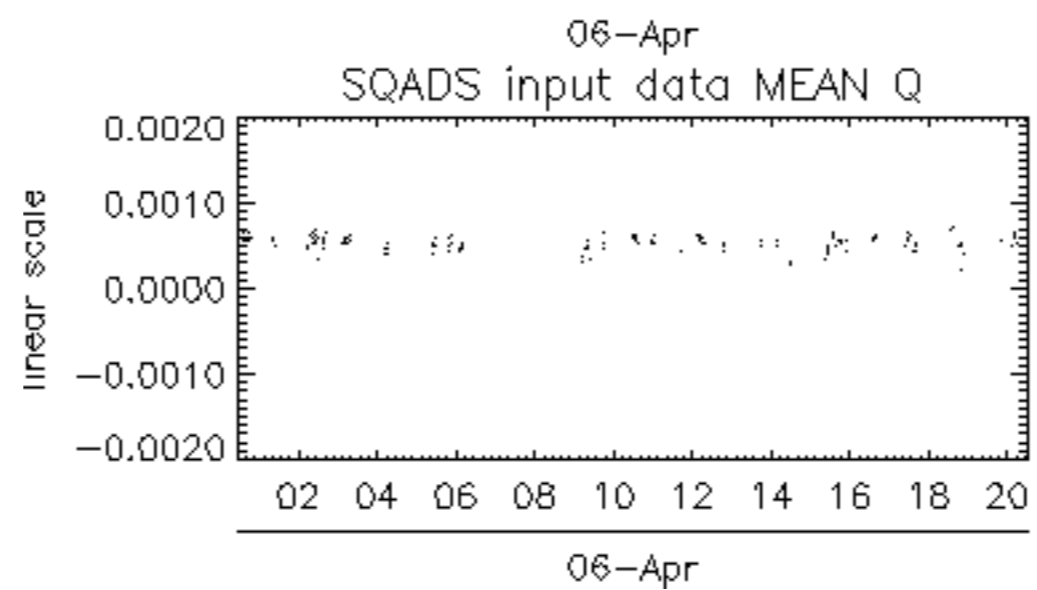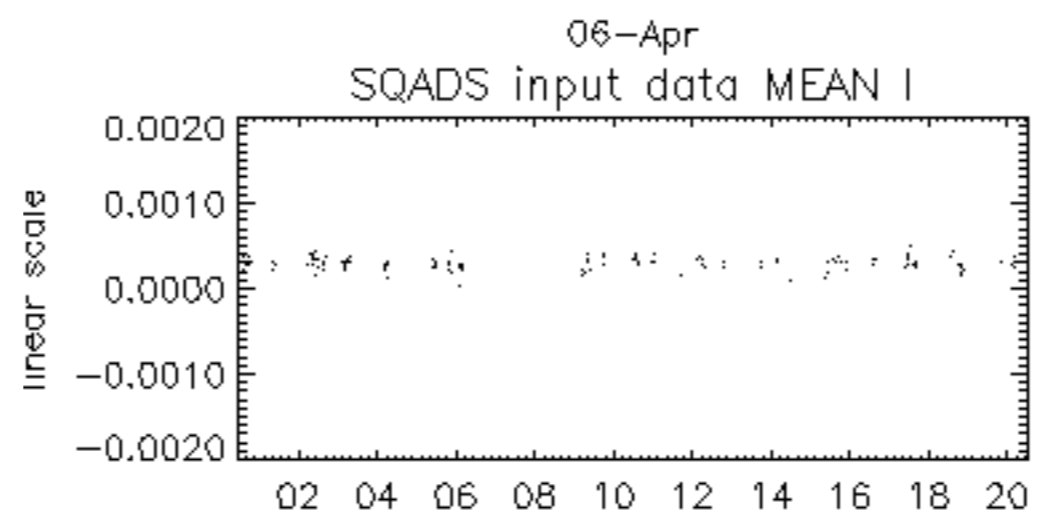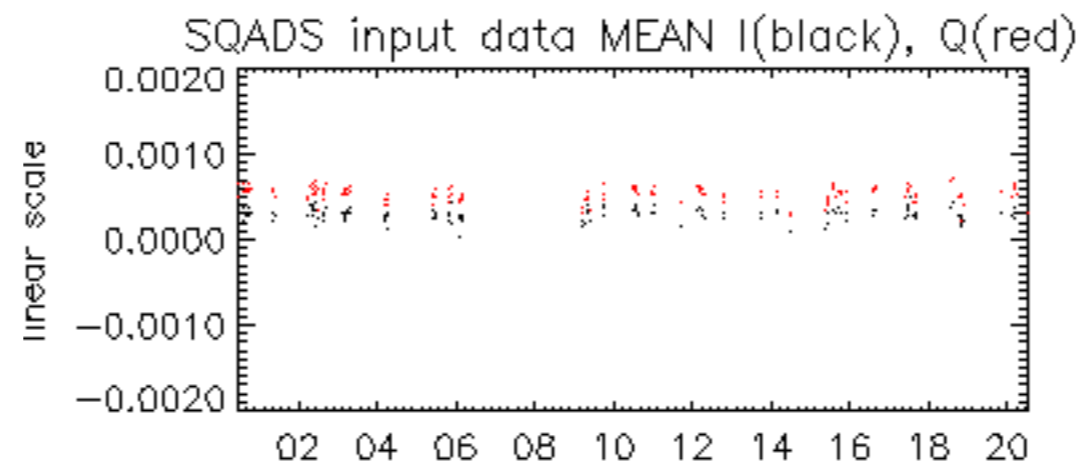


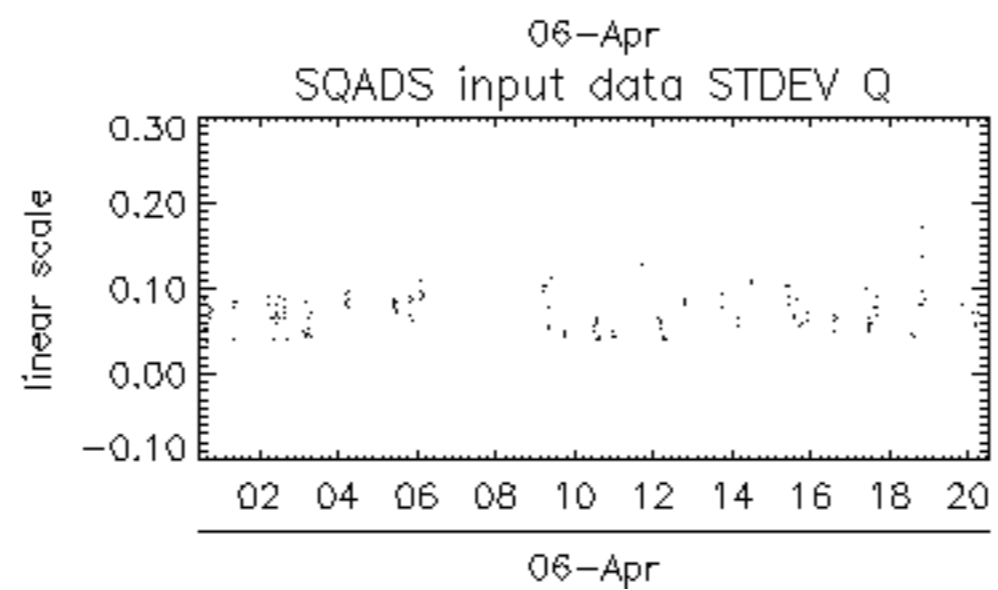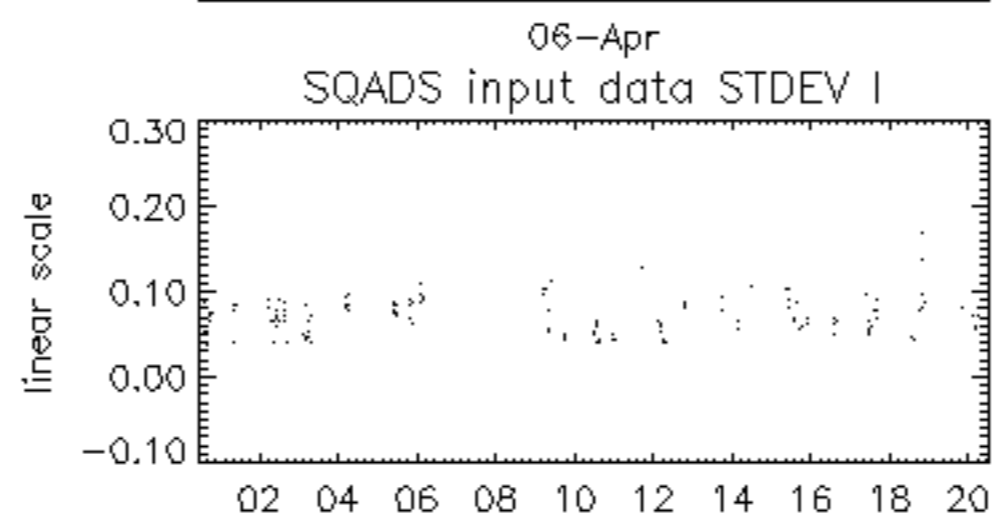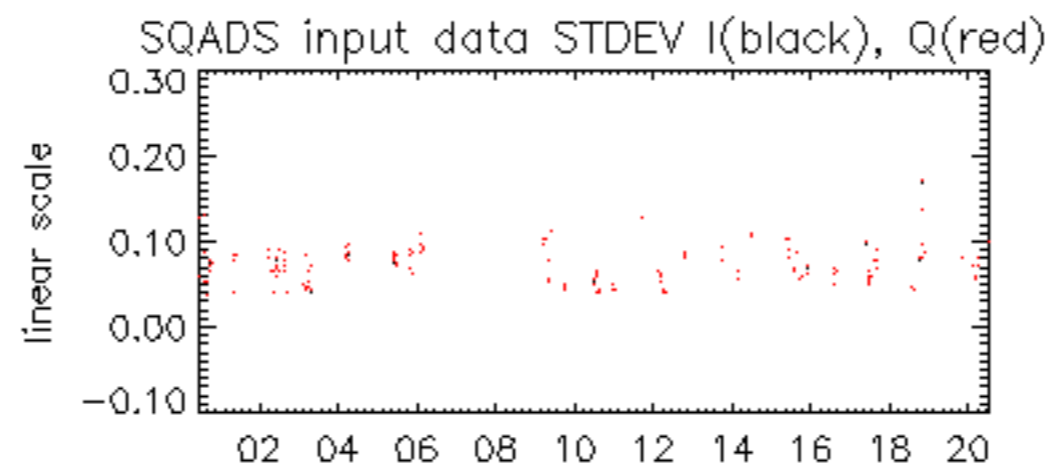

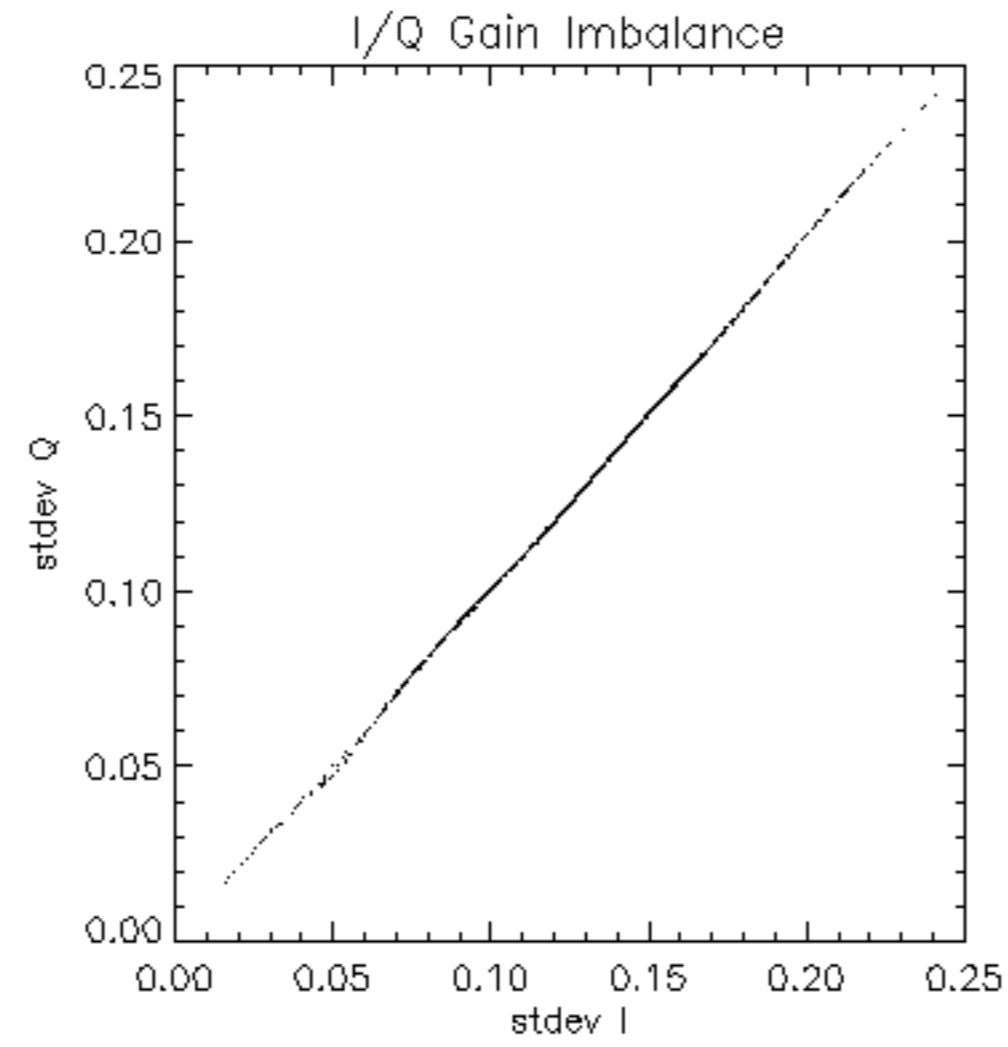


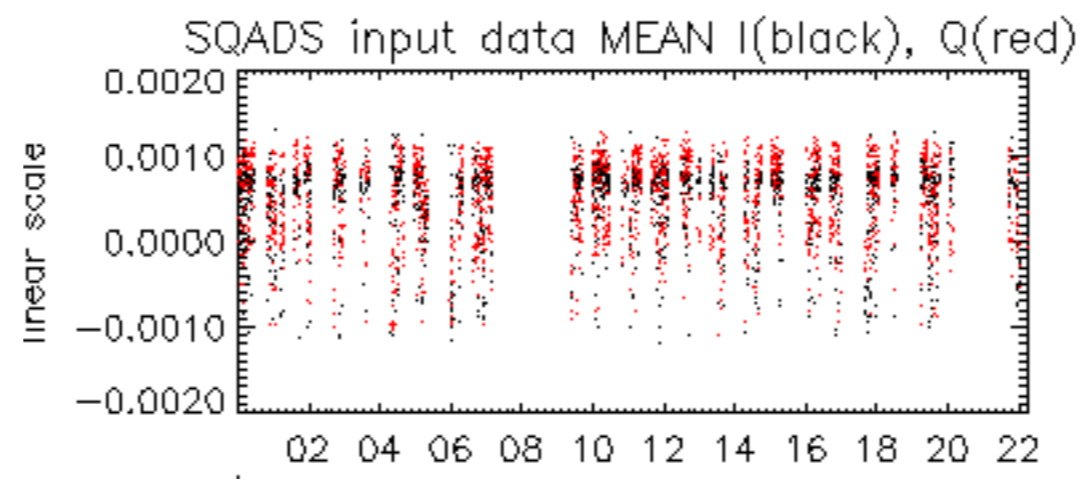

06-Apr

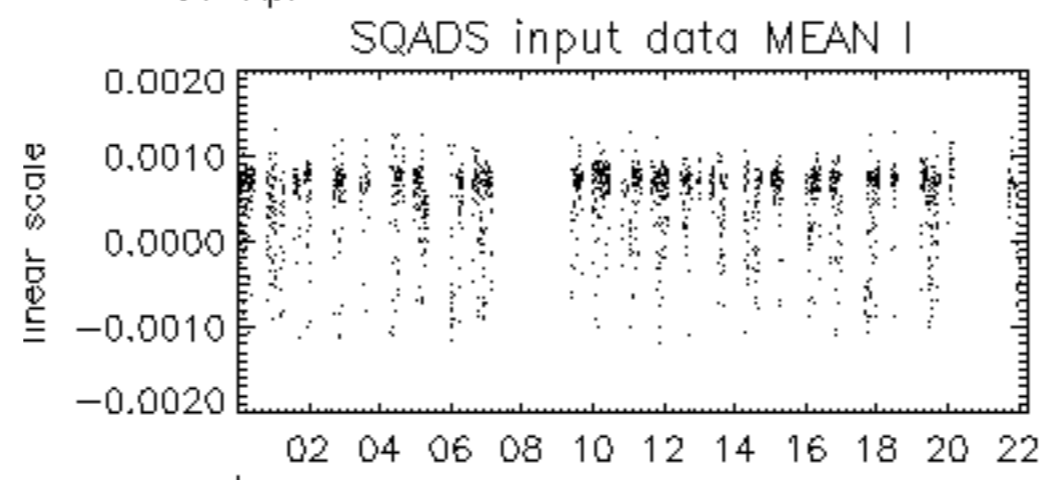

06-Apr

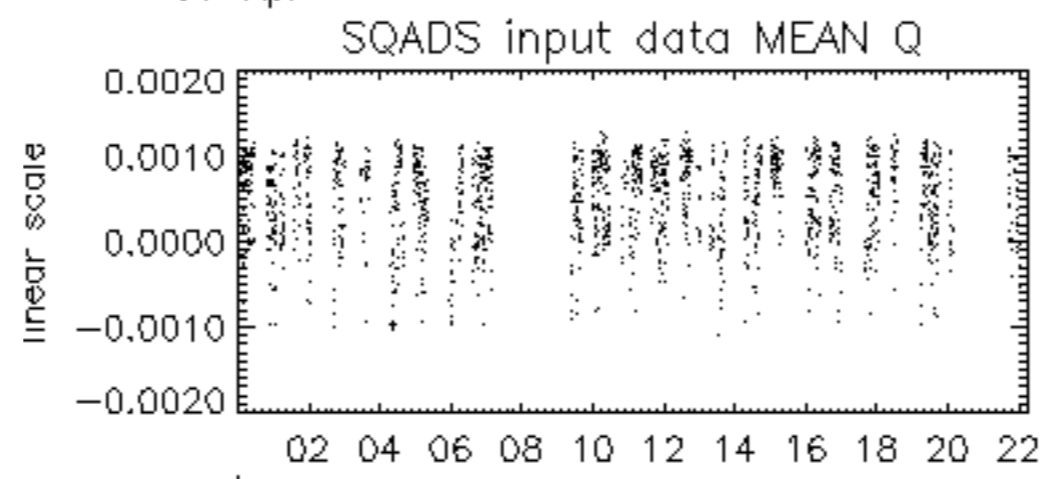

06-Apr

