



Analysis from 05-SEP-2010 00:00:00 to 05-SEP-2010 23:59:59. Page generated on 06-SEP-2010 10:20:49.  
View log file: ASAR\_Daily\_Report\_20100906\_0854.log. For any anomalies please contact emma.griffiths@vega.co.uk, kajal.haria@vega.co.uk.

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

## SUMMARY

1. DATA SUMMARY
  - 1.1 Summary tables
  - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
  - 2.1 IECF operational ADFs list
  - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
  - 3.1 V/V polarisation
  - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
  - 4.1 Analysis for WVS IS2 V/V
    - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
    - 4.1.2 All Rows Analysis for WVS IS2 V/V
  - 4.2 Analysis for GM1 SS3 H/H
    - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
    - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
  - 5.1 Analysis for WVS IS2 V/V
    - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
    - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
  - 5.2 Analysis for GM1 SS1 H/H
    - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
    - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
  - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
  - 6.1 Analysis for WSM SS1 H/H
    - 6.1.1 ScaleFactor
  - 6.2 Analysis for WSM SS1 V/V
    - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
  - 7.1 Analysis for WVS
  - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
  - 8.1 Number of Missing Lines
  - 8.2 Number of Gaps

---

## 1 - DATA SUMMARY

### 1.1 - Summary tables

[ [BACK TO MENU](#) ]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	4	PDE	WS	H/H	42					PDE	IS2	H/H	18	PDE	WS	H/H	22	PDE	2010-09-05 05:31:56	V	320
PDE	IS2	V/V	25	PDK	WS	H/H	46					PDE	IS2	V/V	9	PDE	WS	V/V	8				
PDK	IS2	V/V	23									PDE	IS4	H/H	1	PDK	WS	H/H	14				
												PDE	IS4	V/V	1	PDK	WS	V/V	9				
												PDE	IS6	V/V	1								
												PDE	IS7	V/V	1								
												PDK	IS2	H/H	3								
												PDK	IS2	V/V	4								
												PDK	IS3	V/V	1								

## 1.2 - Lists of products used

[ [BACK TO MENU](#) ]

[[TXT](#)] [[XLS](#)] [List\\_WVS\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_GM1\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_IMM\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_WSM\\_products\\_used](#)  
 [[TXT](#)] [[XLS](#)] [List\\_MS\\_products\\_used](#)

## 2 - AUXILIARY FILES ANALYSIS

### 2.1 - IECF operational ADFs list

[ [BACK TO MENU](#) ]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20100608_125449_20100317_120410_20101231_000000
ASA_INS_AXVIEC20091217_114637_20090428_100000_20101231_235959
ASA_XCH_AXVIEC20091217_113006_20020301_000000_20101231_000000
ASA_XCA_AXVIEC20100608_123419_20100317_120410_20110101_000000

### 2.2 - Products with wrong ADFs

[ [BACK TO MENU](#) ]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0

[[TXT](#)] [[XLS](#)] [Check\\_ADFs\\_WVS](#)  
 [[TXT](#)] [[XLS](#)] [Check\\_ADFs\\_GM1](#)  
 [[TXT](#)] [[XLS](#)] [Check\\_ADFs\\_IMM](#)  
 [[TXT](#)] [[XLS](#)] [Check\\_ADFs\\_WSM](#)

### 3 - MODULE STEPPING PRODUCTS ANALYSIS








### 3.2 - H/H polarisation

[ [BACK TO MENU](#) ]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
Pre-launch reference (2001-02-09)	Previous product in the same polarisation

Reference: 2001-02-09 13:50:42 H RxGain

Test : 2010-09-04 06:03:33 H

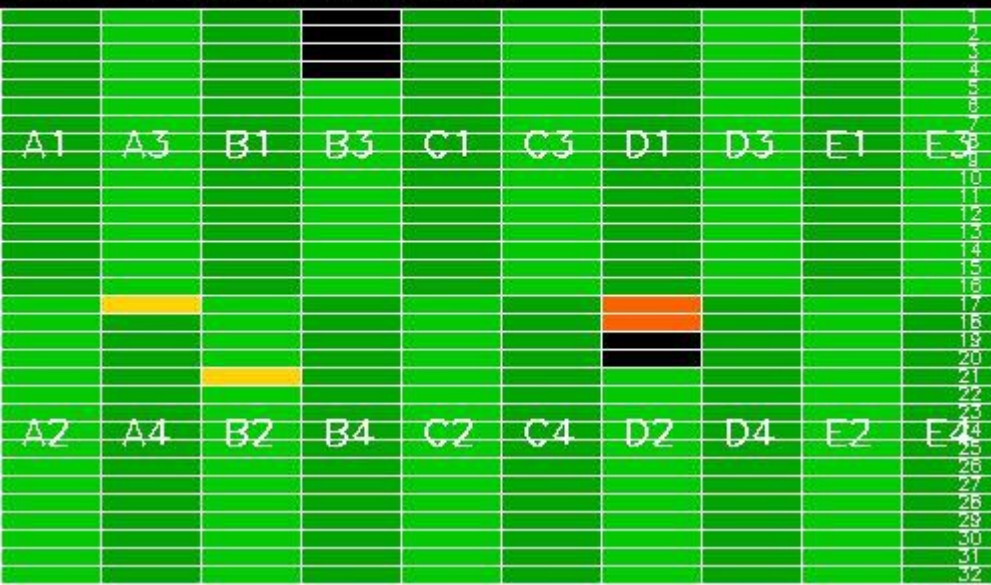

Reference: 2010-09-02 07:06:47 H RxGain

Test : 2010-09-04 06:03:33 H




Reference: 2001-02-09 13:50:42 H RxPhase

Test : 2010-09-04 06:03:33 H






Reference: 2010-09-02 07:06:47 H RxPhase

Test : 2010-09-04 06:03:33 H

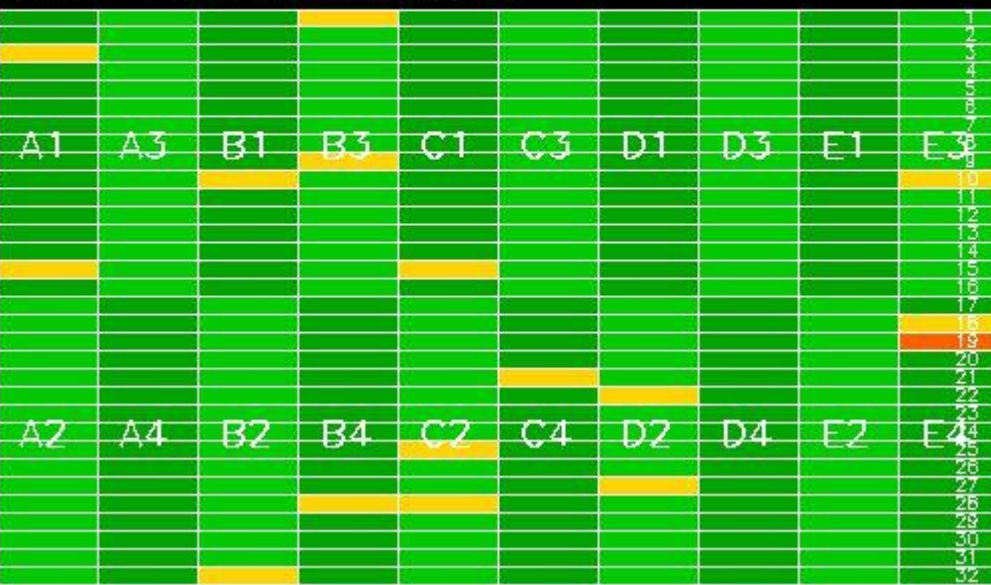



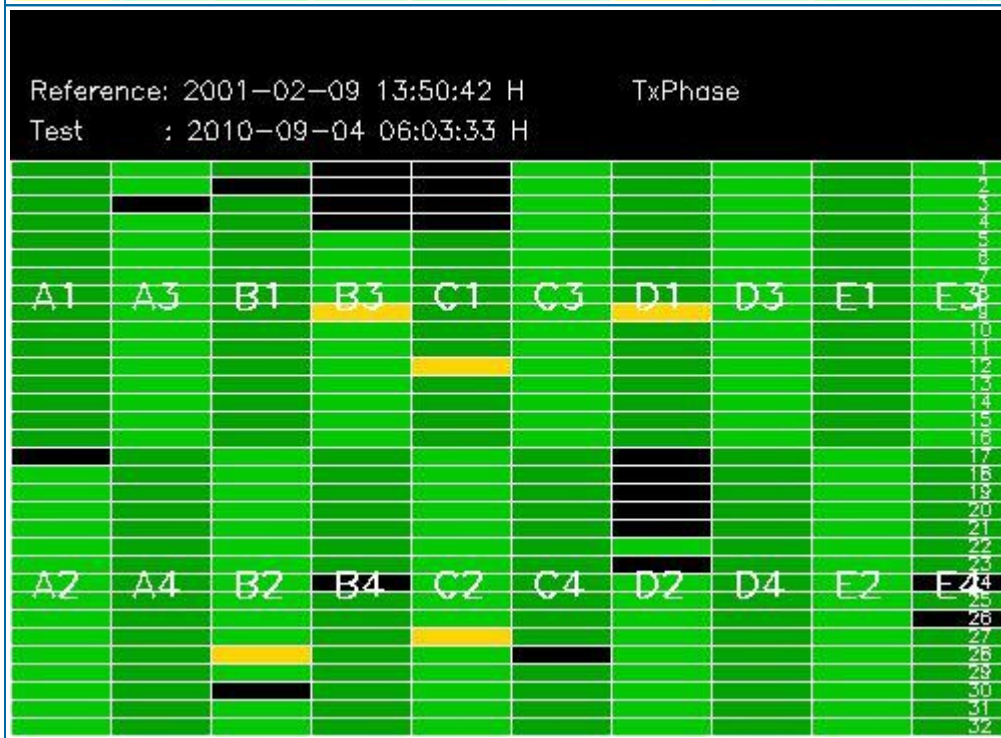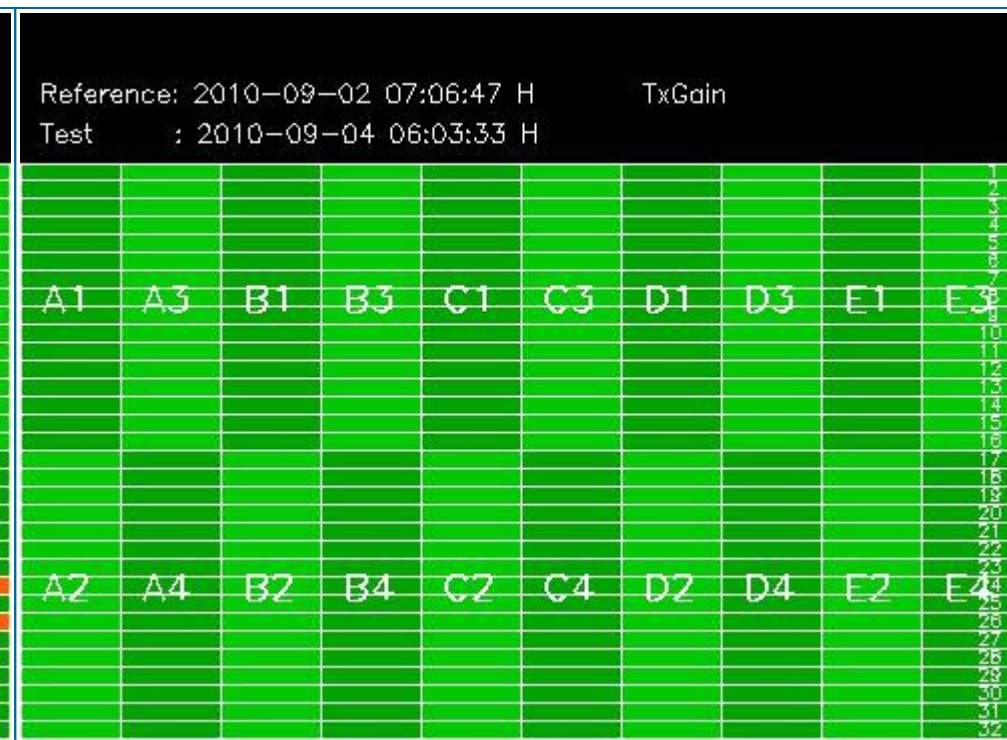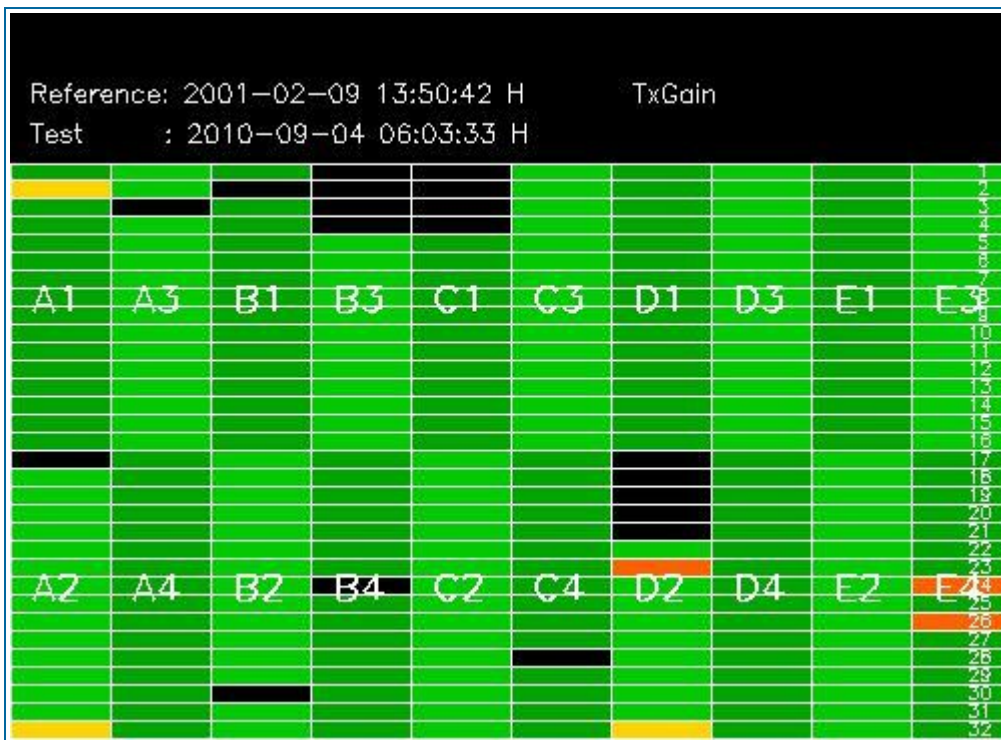

## 4 - CALIBRATION PULSES ANALYSIS

### 4.1 - Analysis for WVS IS2 V/V


#### 4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[ BACK TO MENU ]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for WVS IS2 V/V

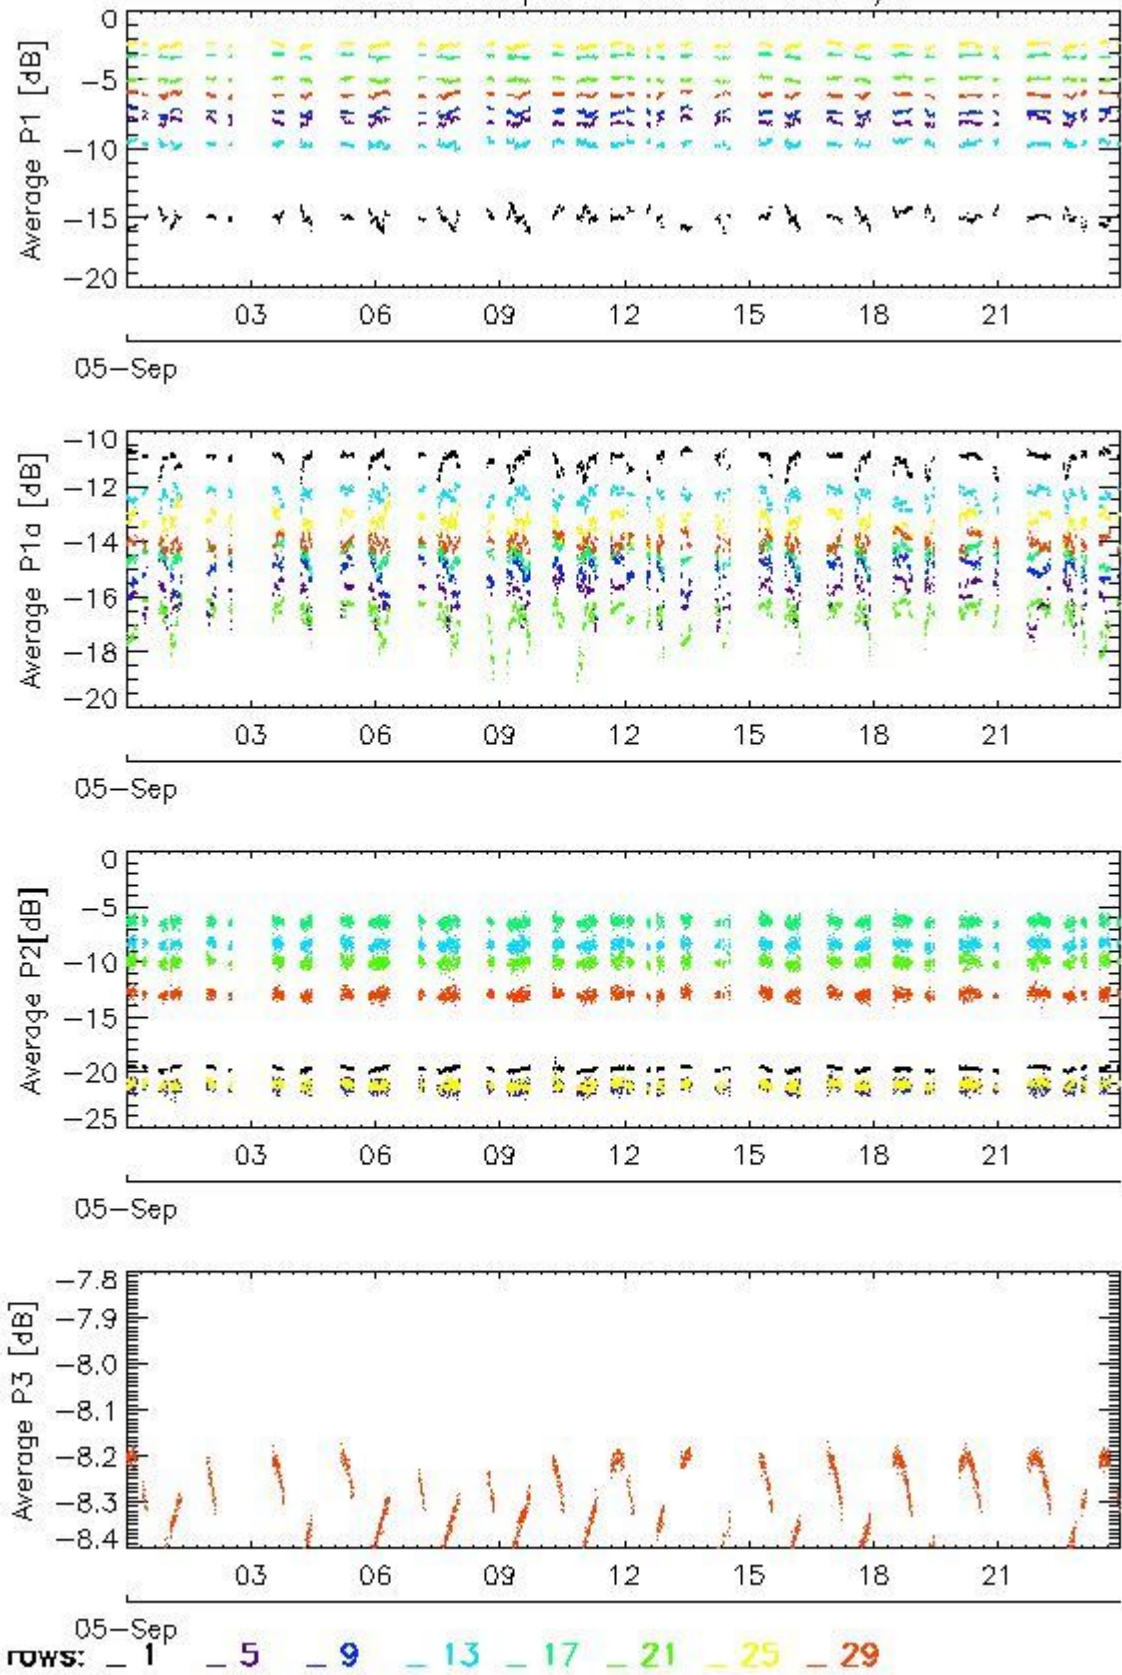

Transmit power (P1 - P1a) for WVS IS2 V/V

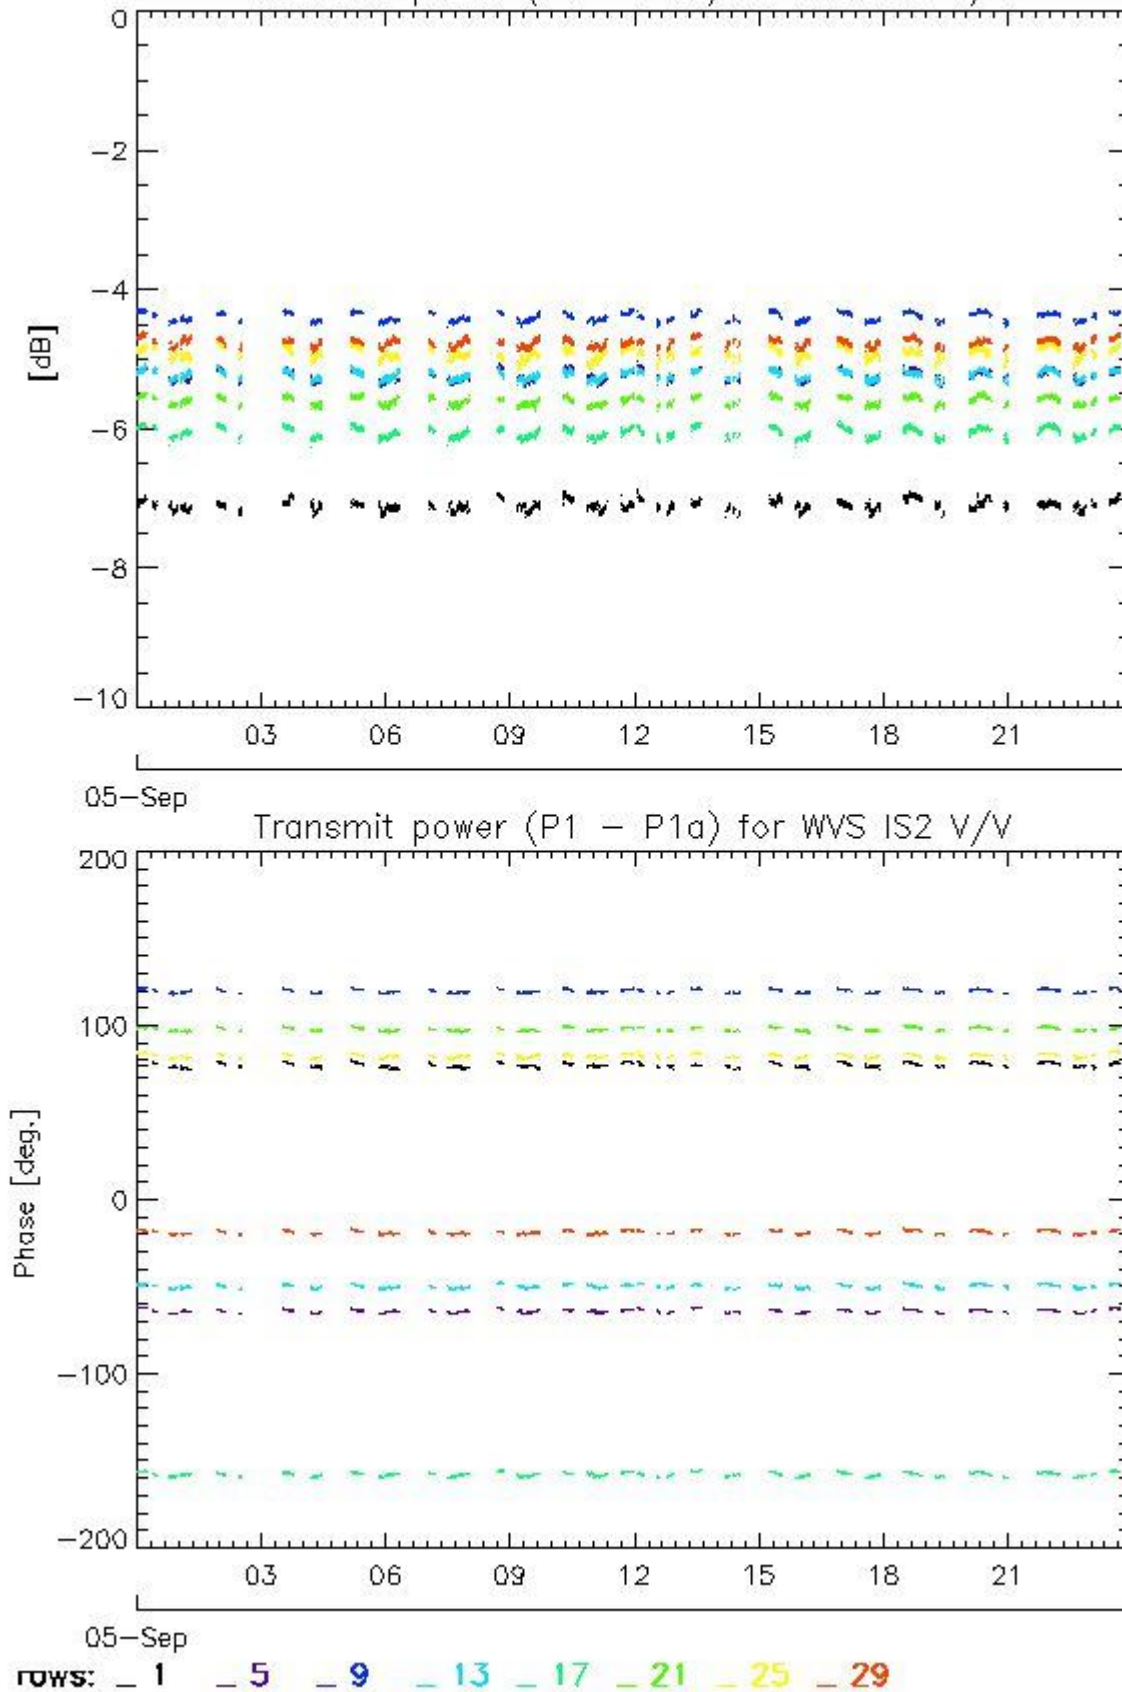


#### 4.1.2 - All Rows Analysis for WVS IS2 V/V

[ [BACK TO MENU](#) ]





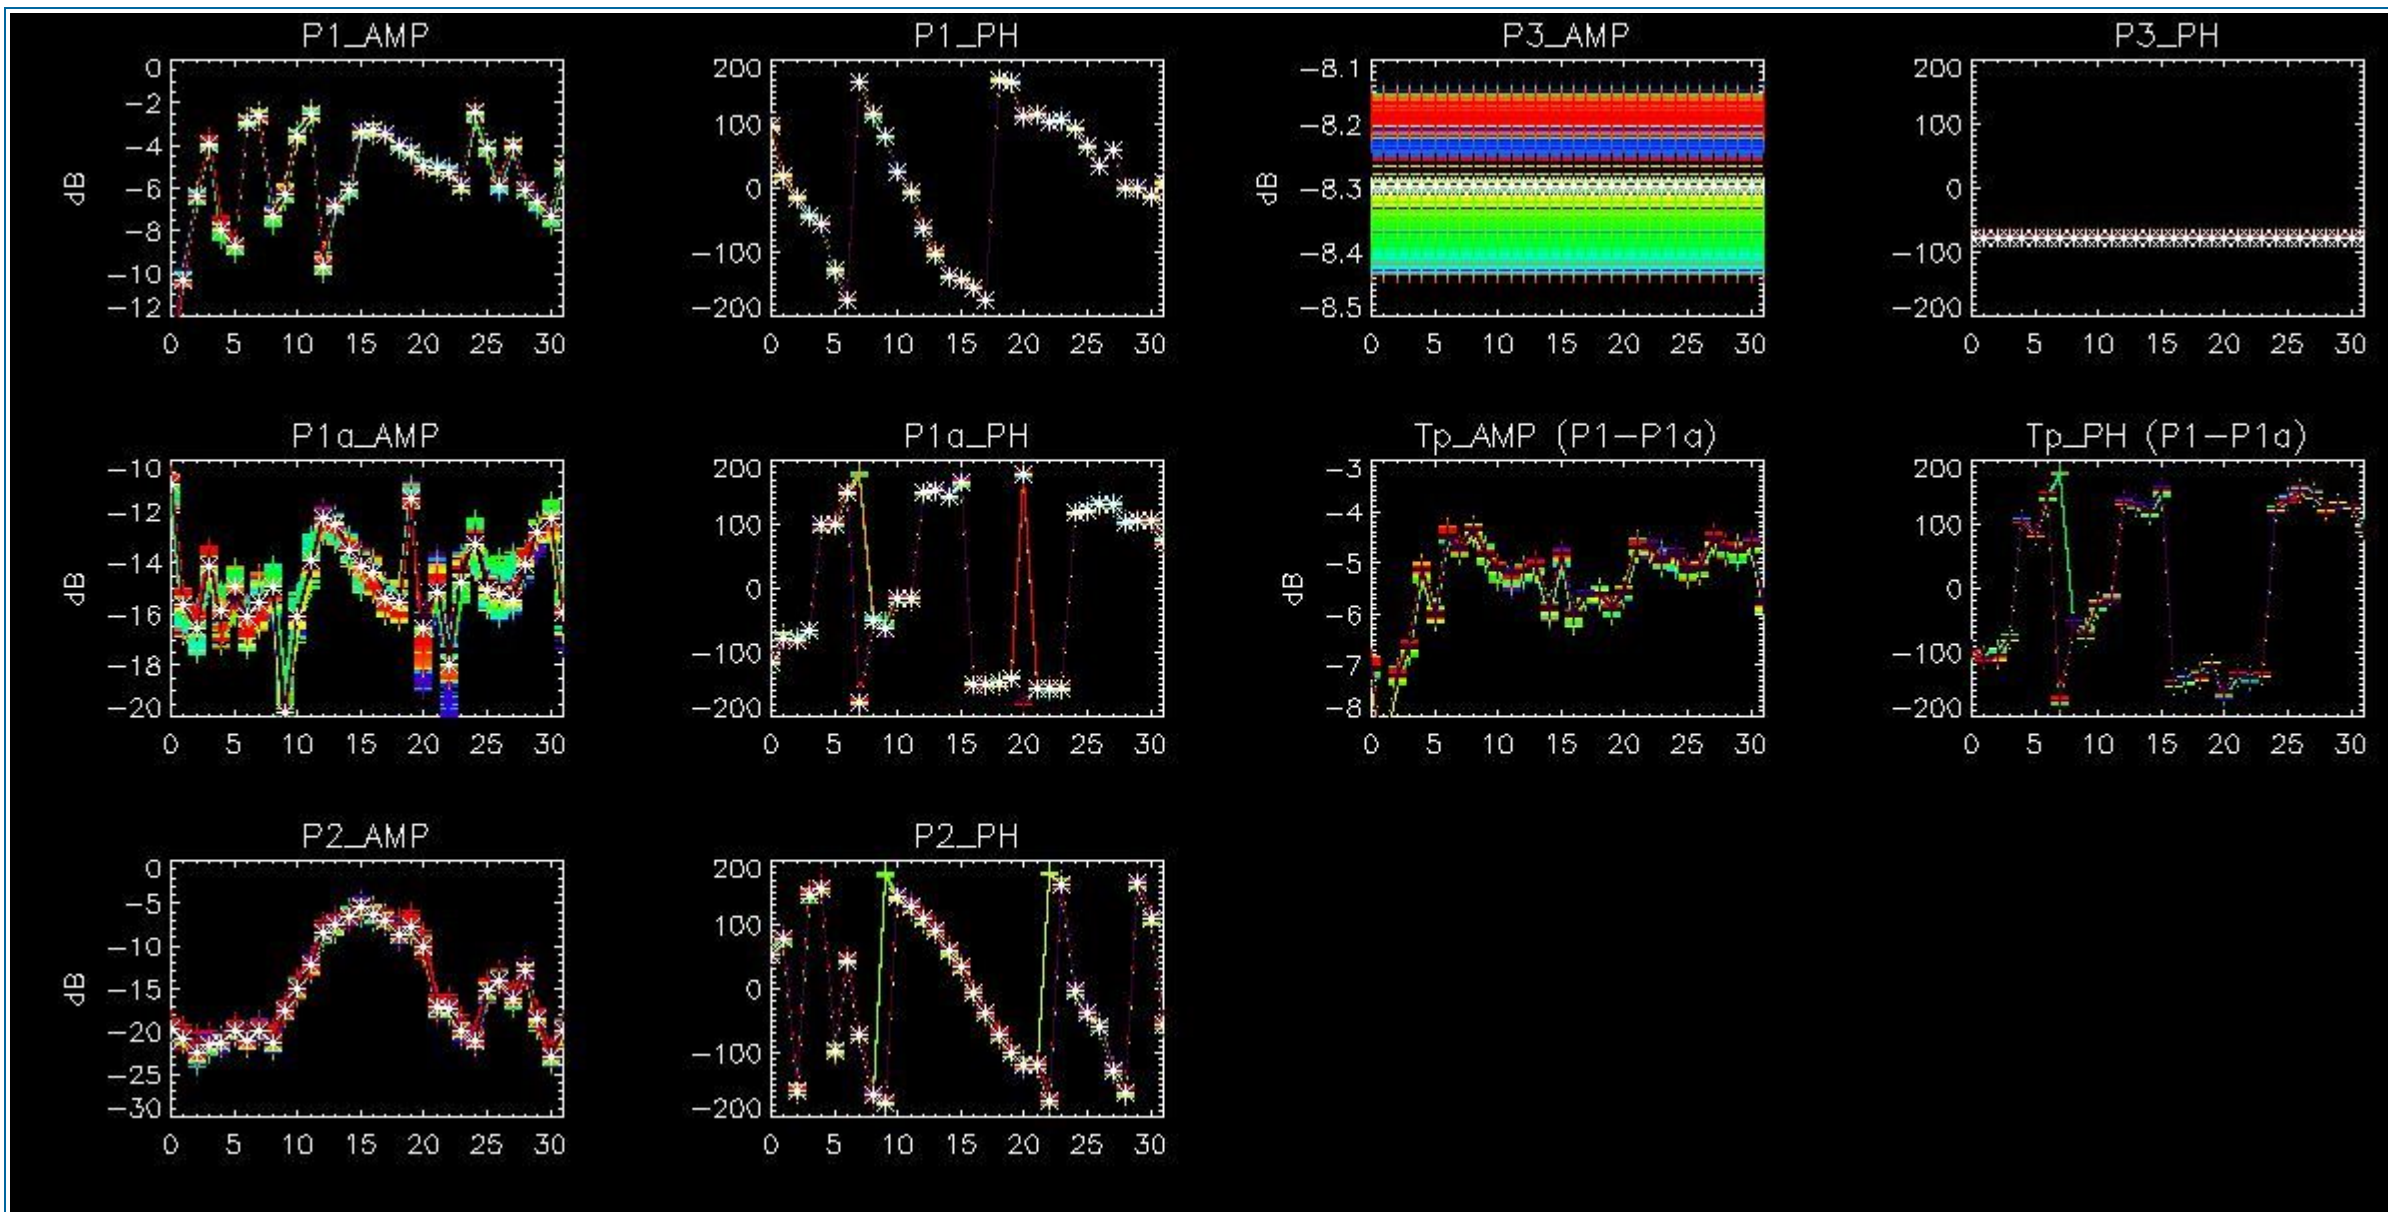

## 4.2 - Analysis for GM1 SS3 H/H

### 4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H


[ BACK TO MENU ]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]



Calibration pulses for GM1 SS3 H/H

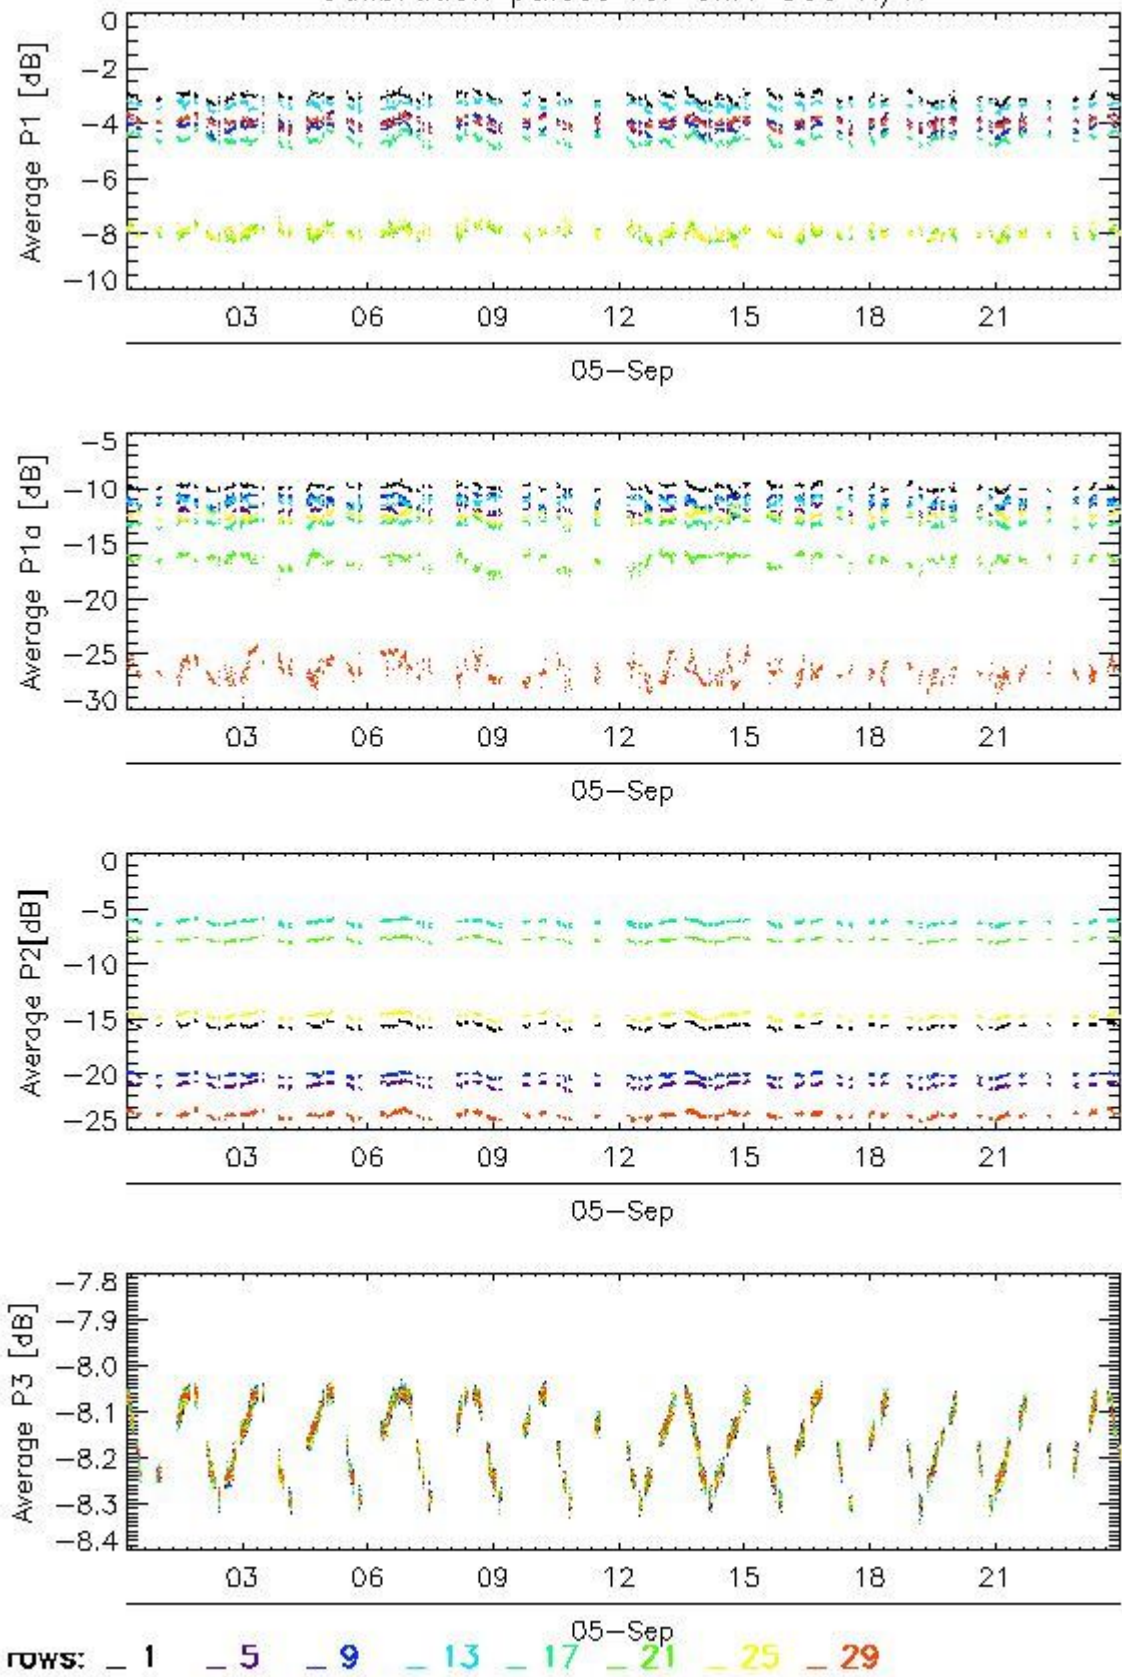


Transmit power (P1 - P1a) for GM1 SS3 H/H

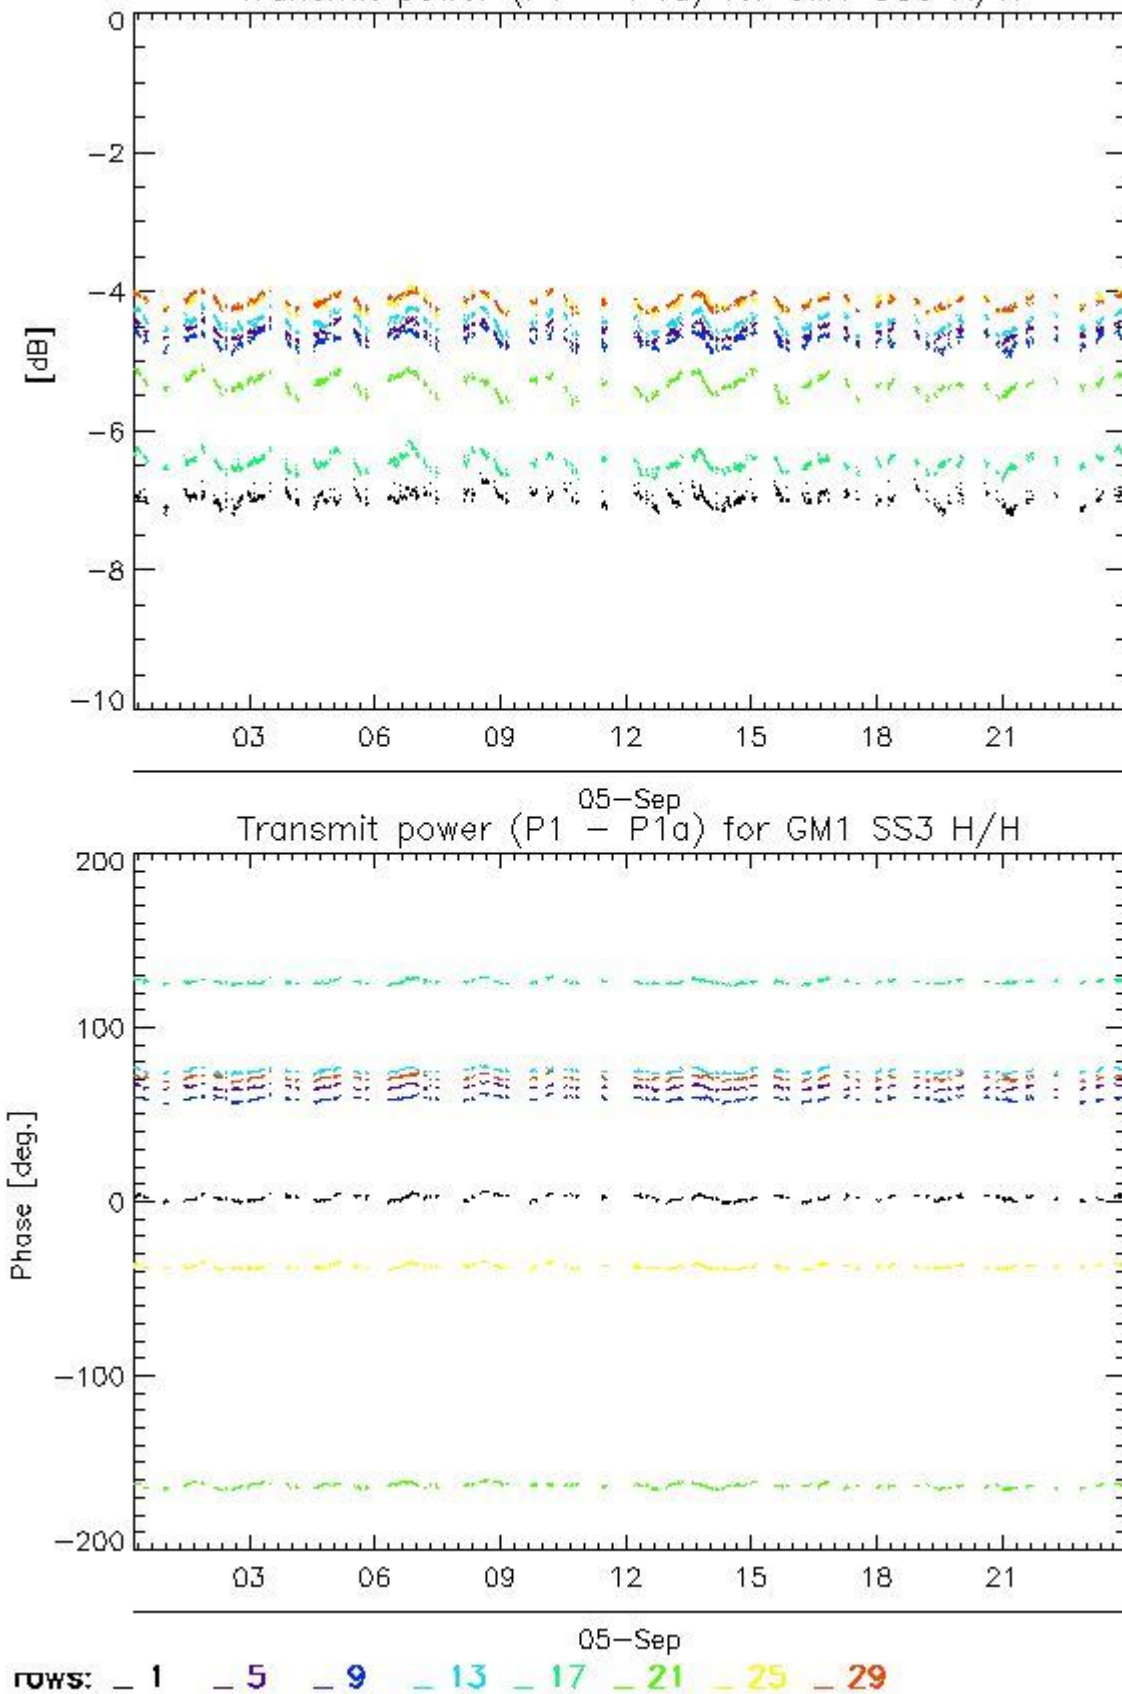

#### 4.2.2 - All Rows Analysis for GM1 SS3 H/H

[ [BACK TO MENU](#) ]



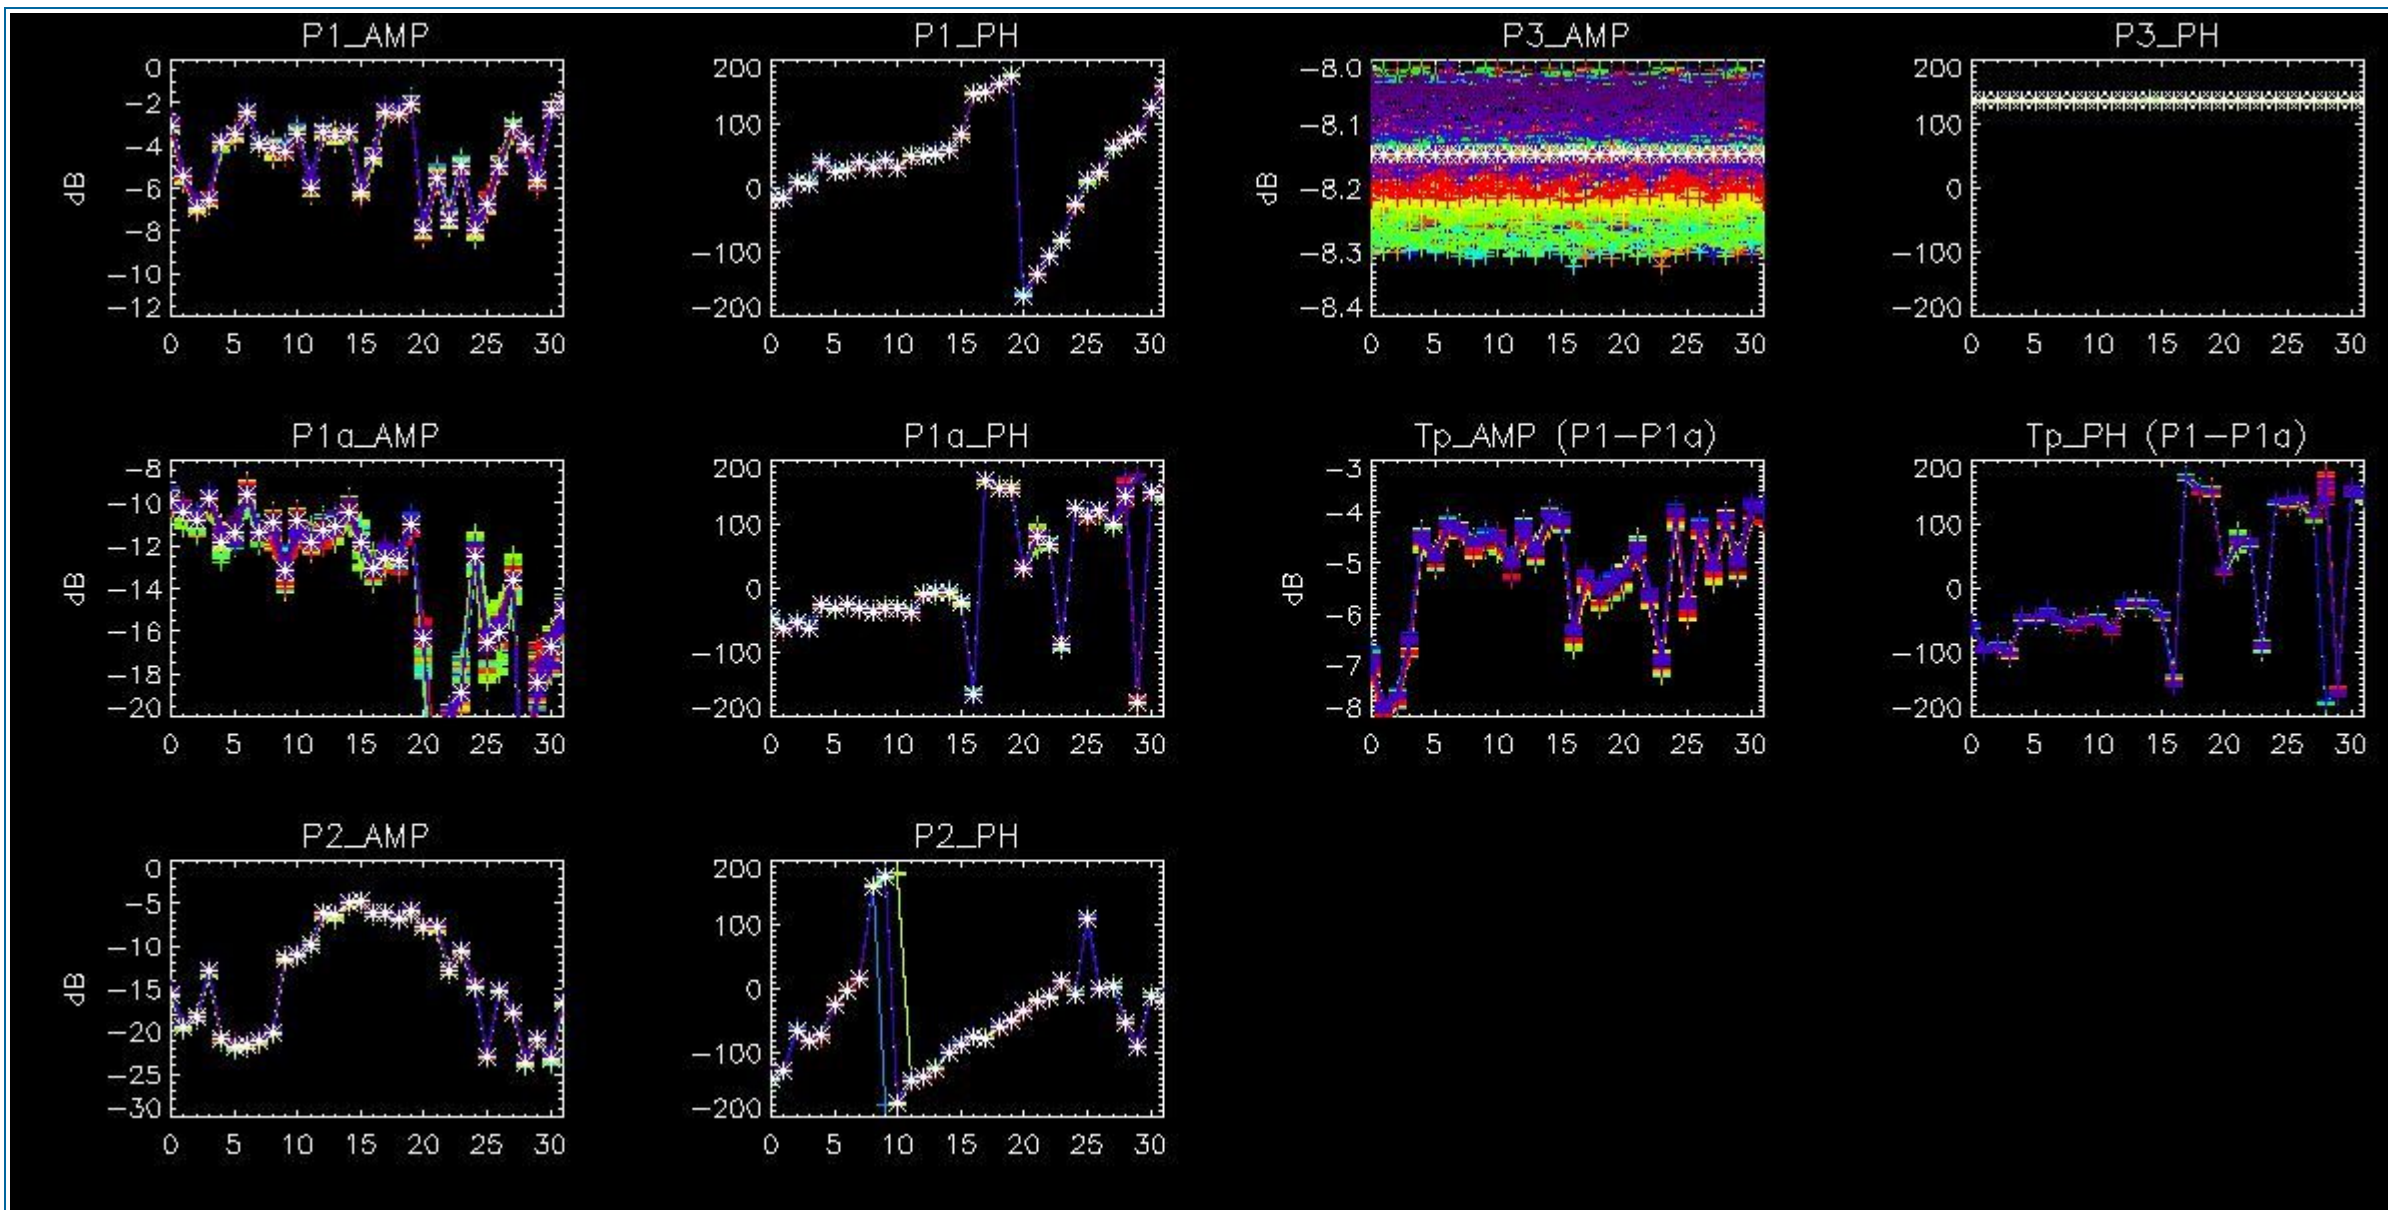

## 5 - DOPPLER ANALYSIS


### 5.1 - Analysis for WVS IS2 V/V

#### 5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[ [BACK TO MENU](#) ]






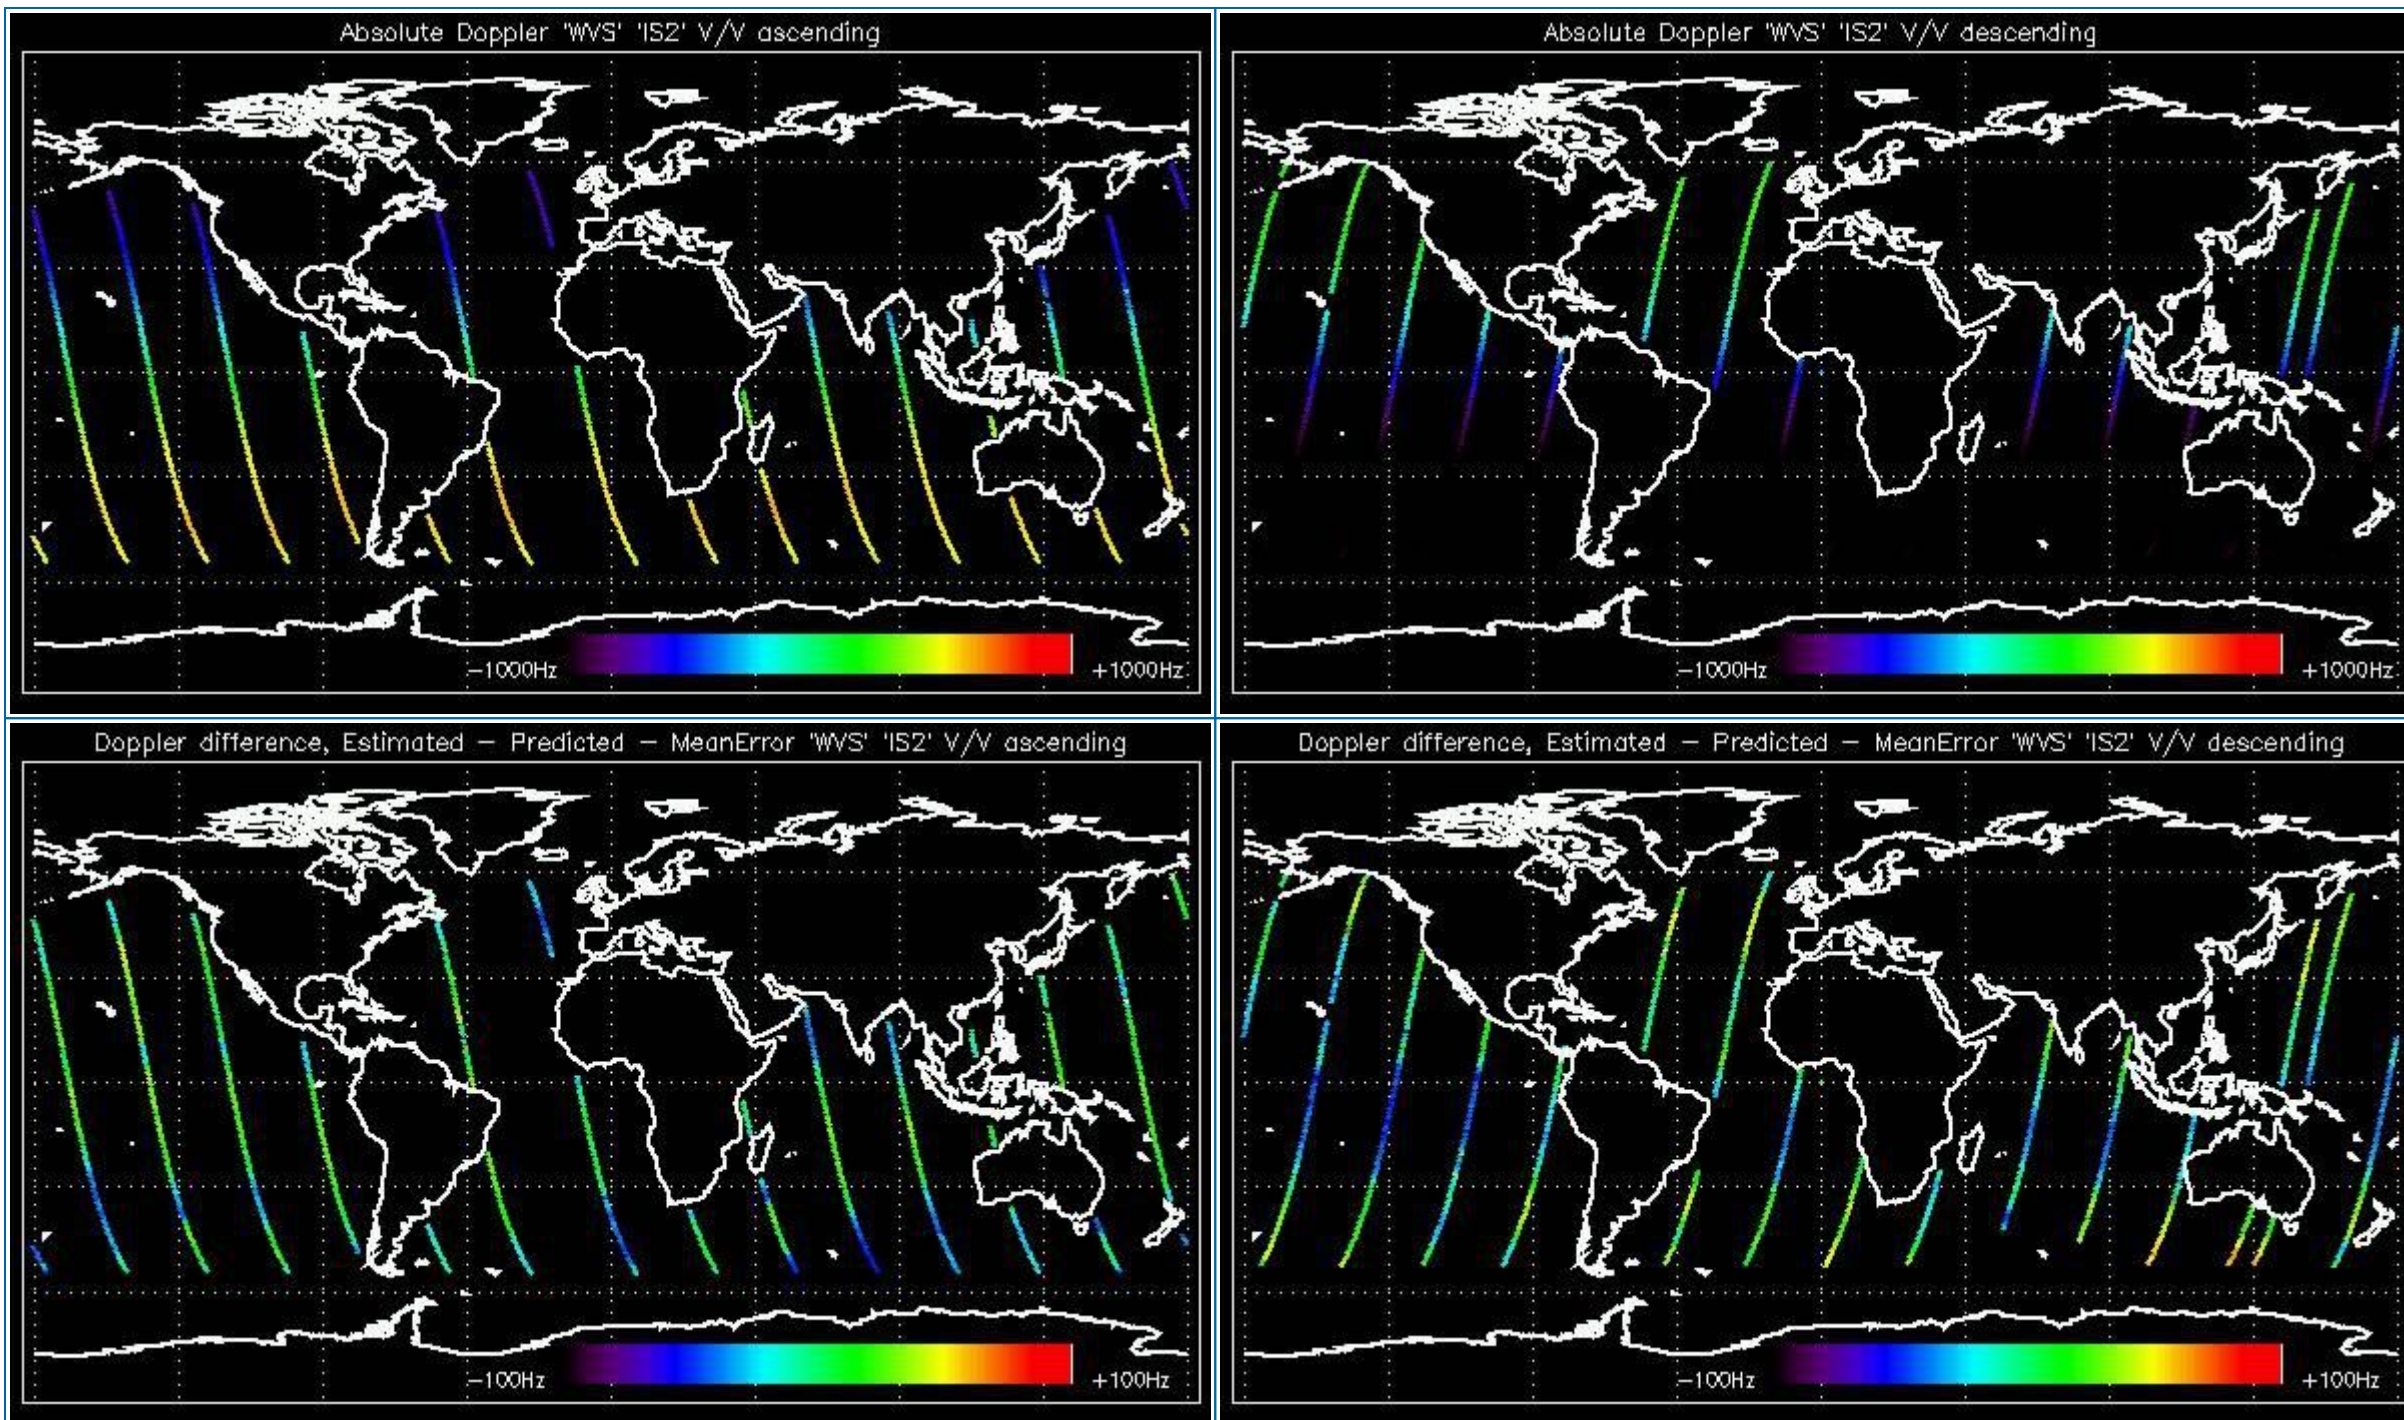

### 5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[ [BACK TO MENU](#) ]



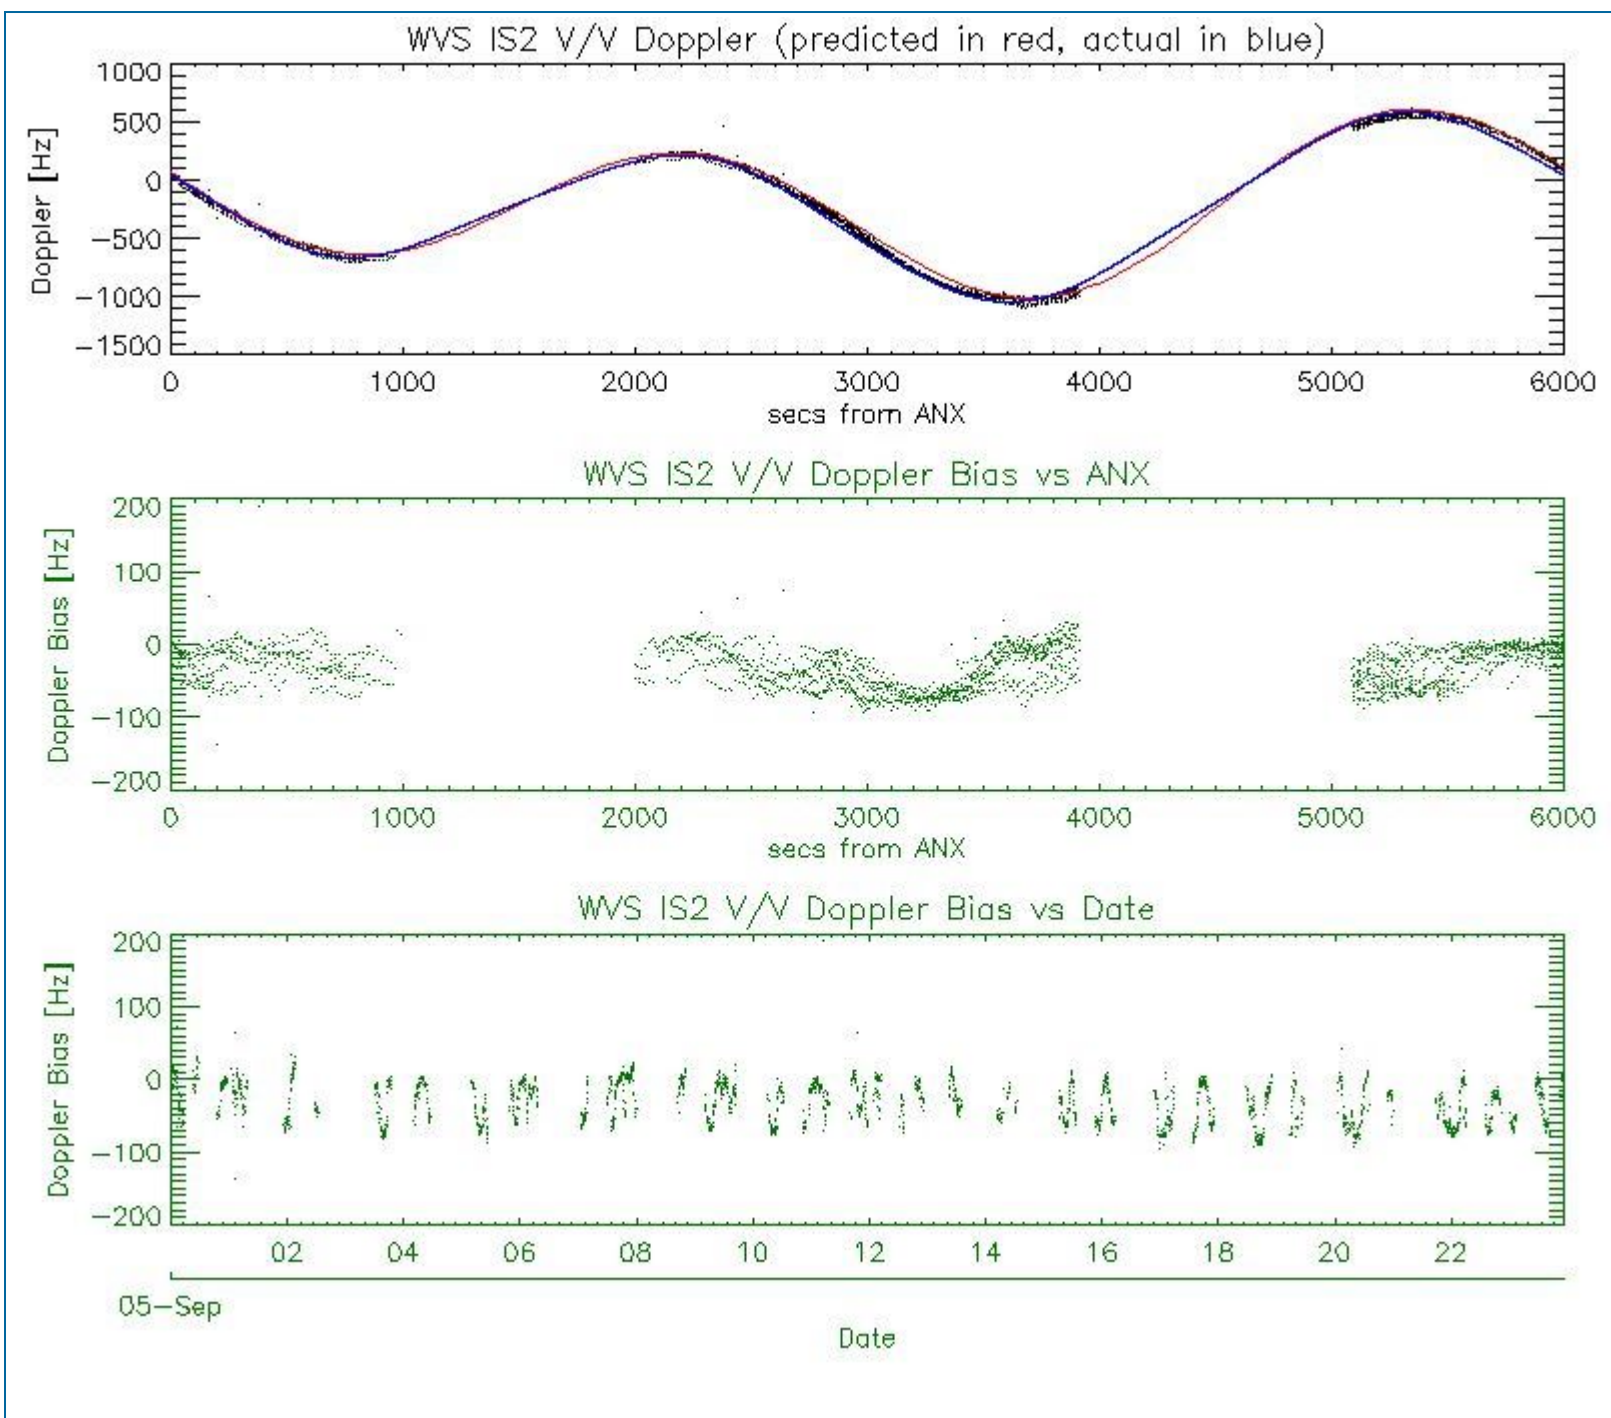


## 5.2 - Analysis for GM1 SS1 H/H

### 5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[ [BACK TO MENU](#) ]






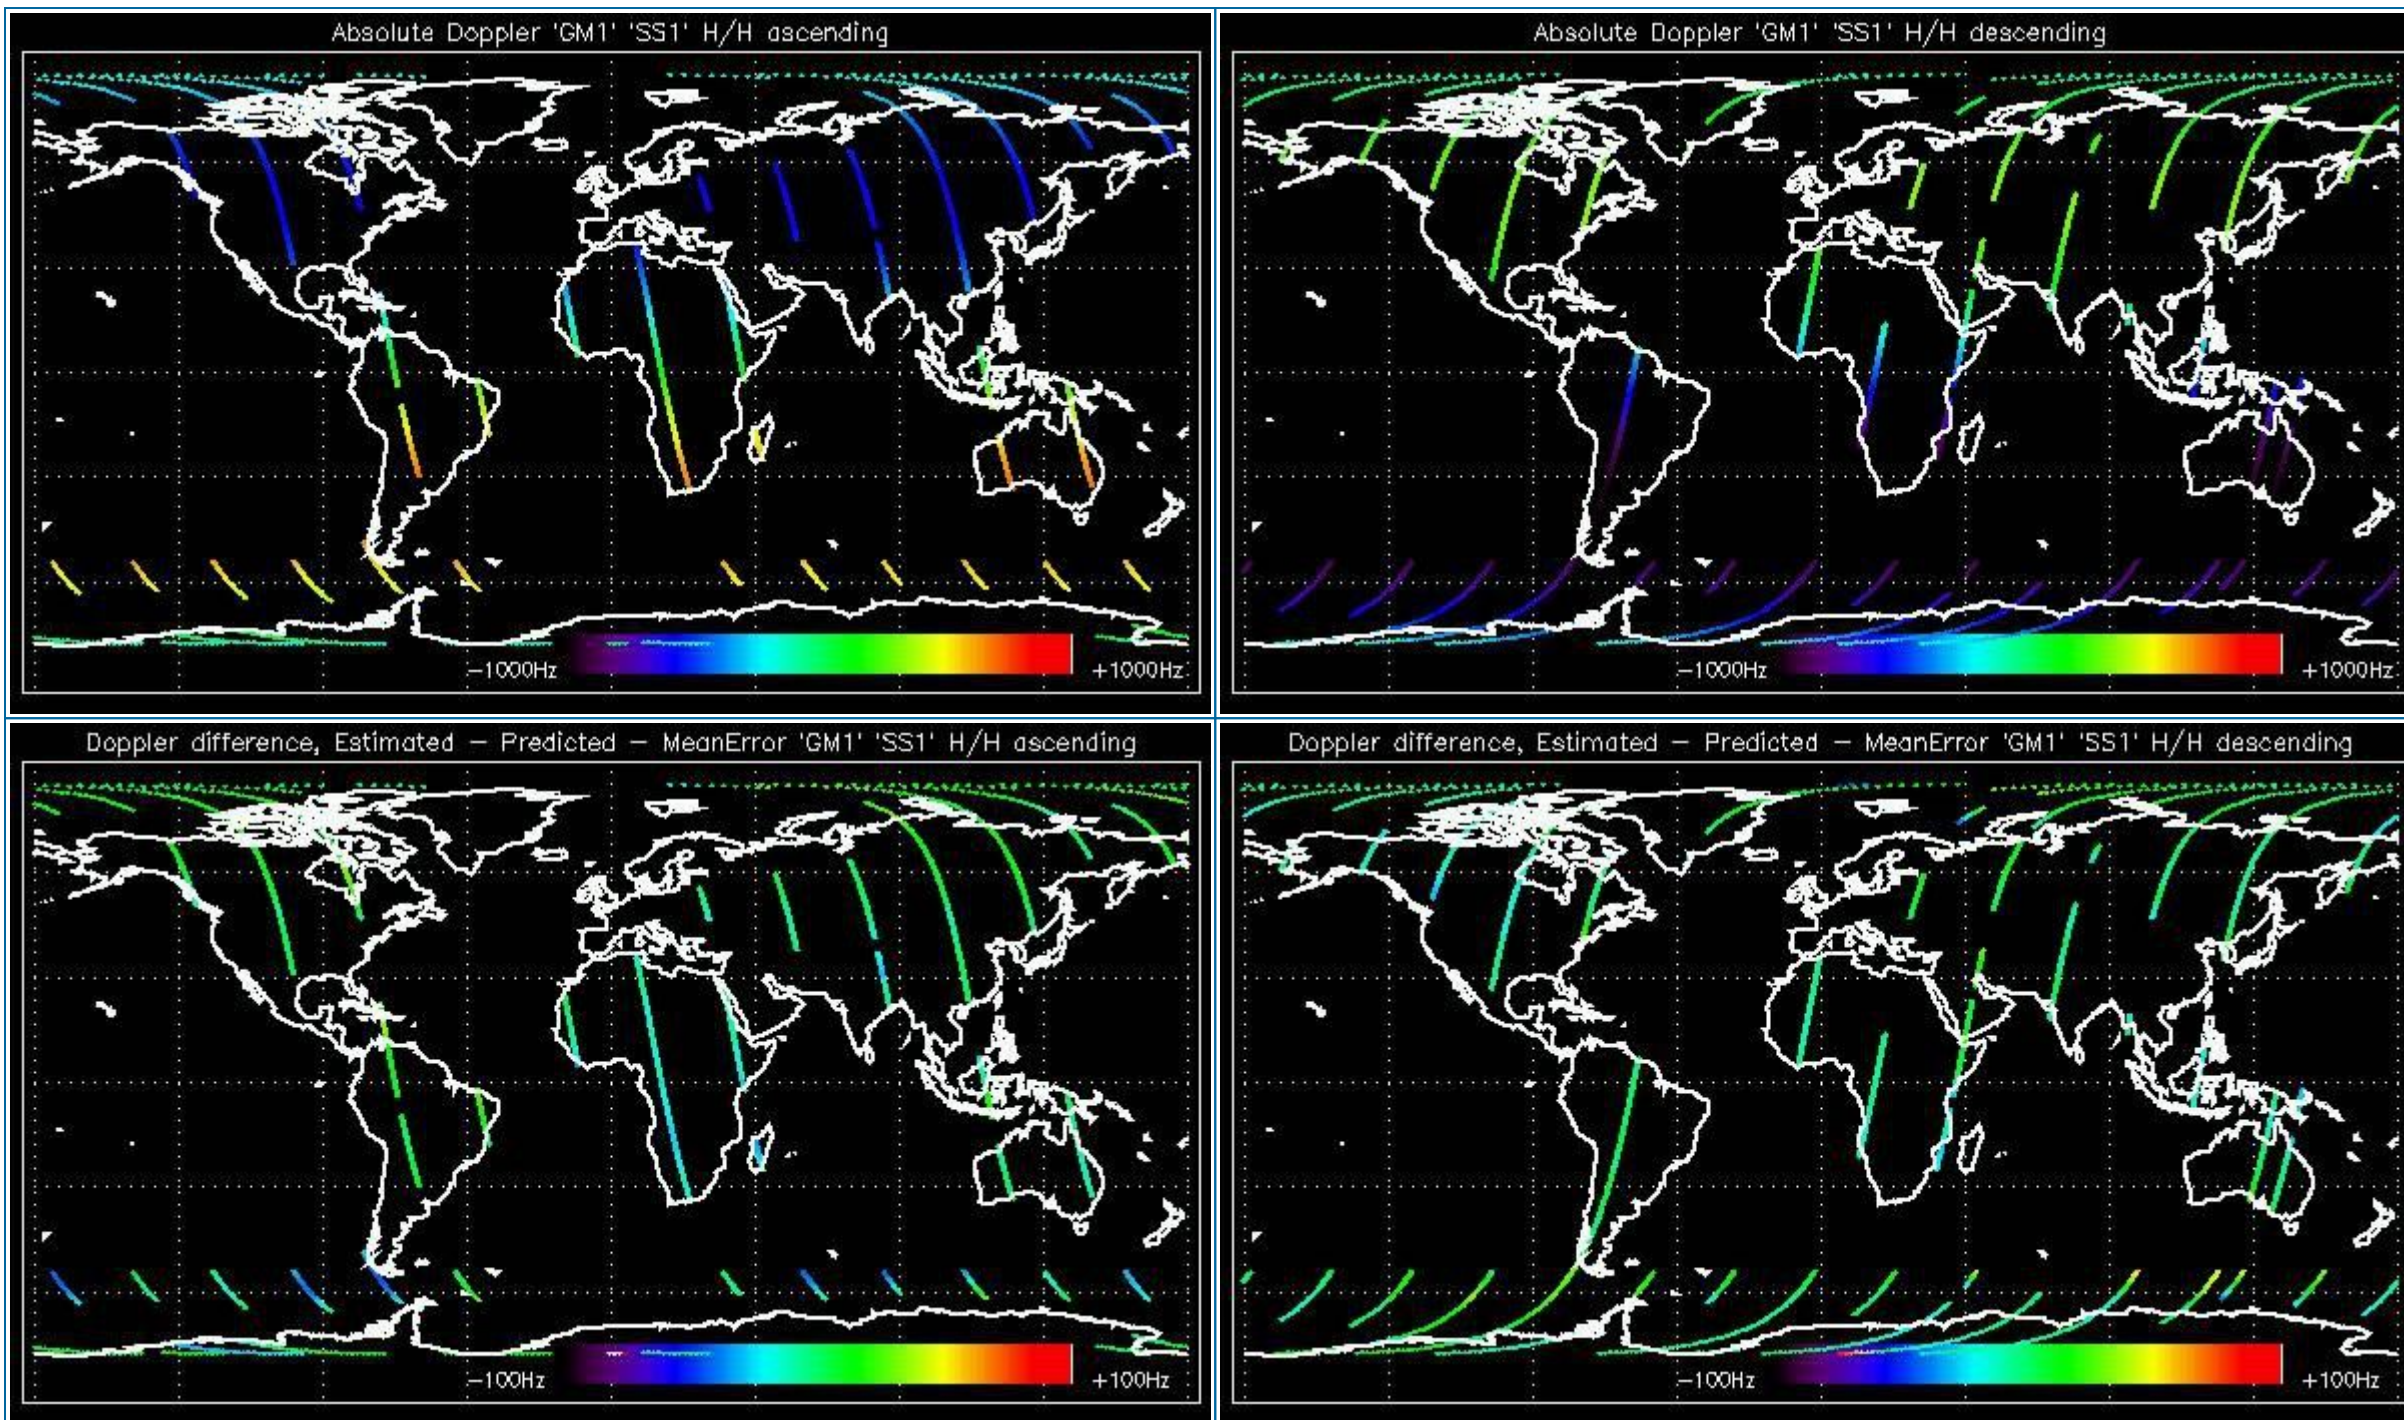

### 5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[ [BACK TO MENU](#) ]



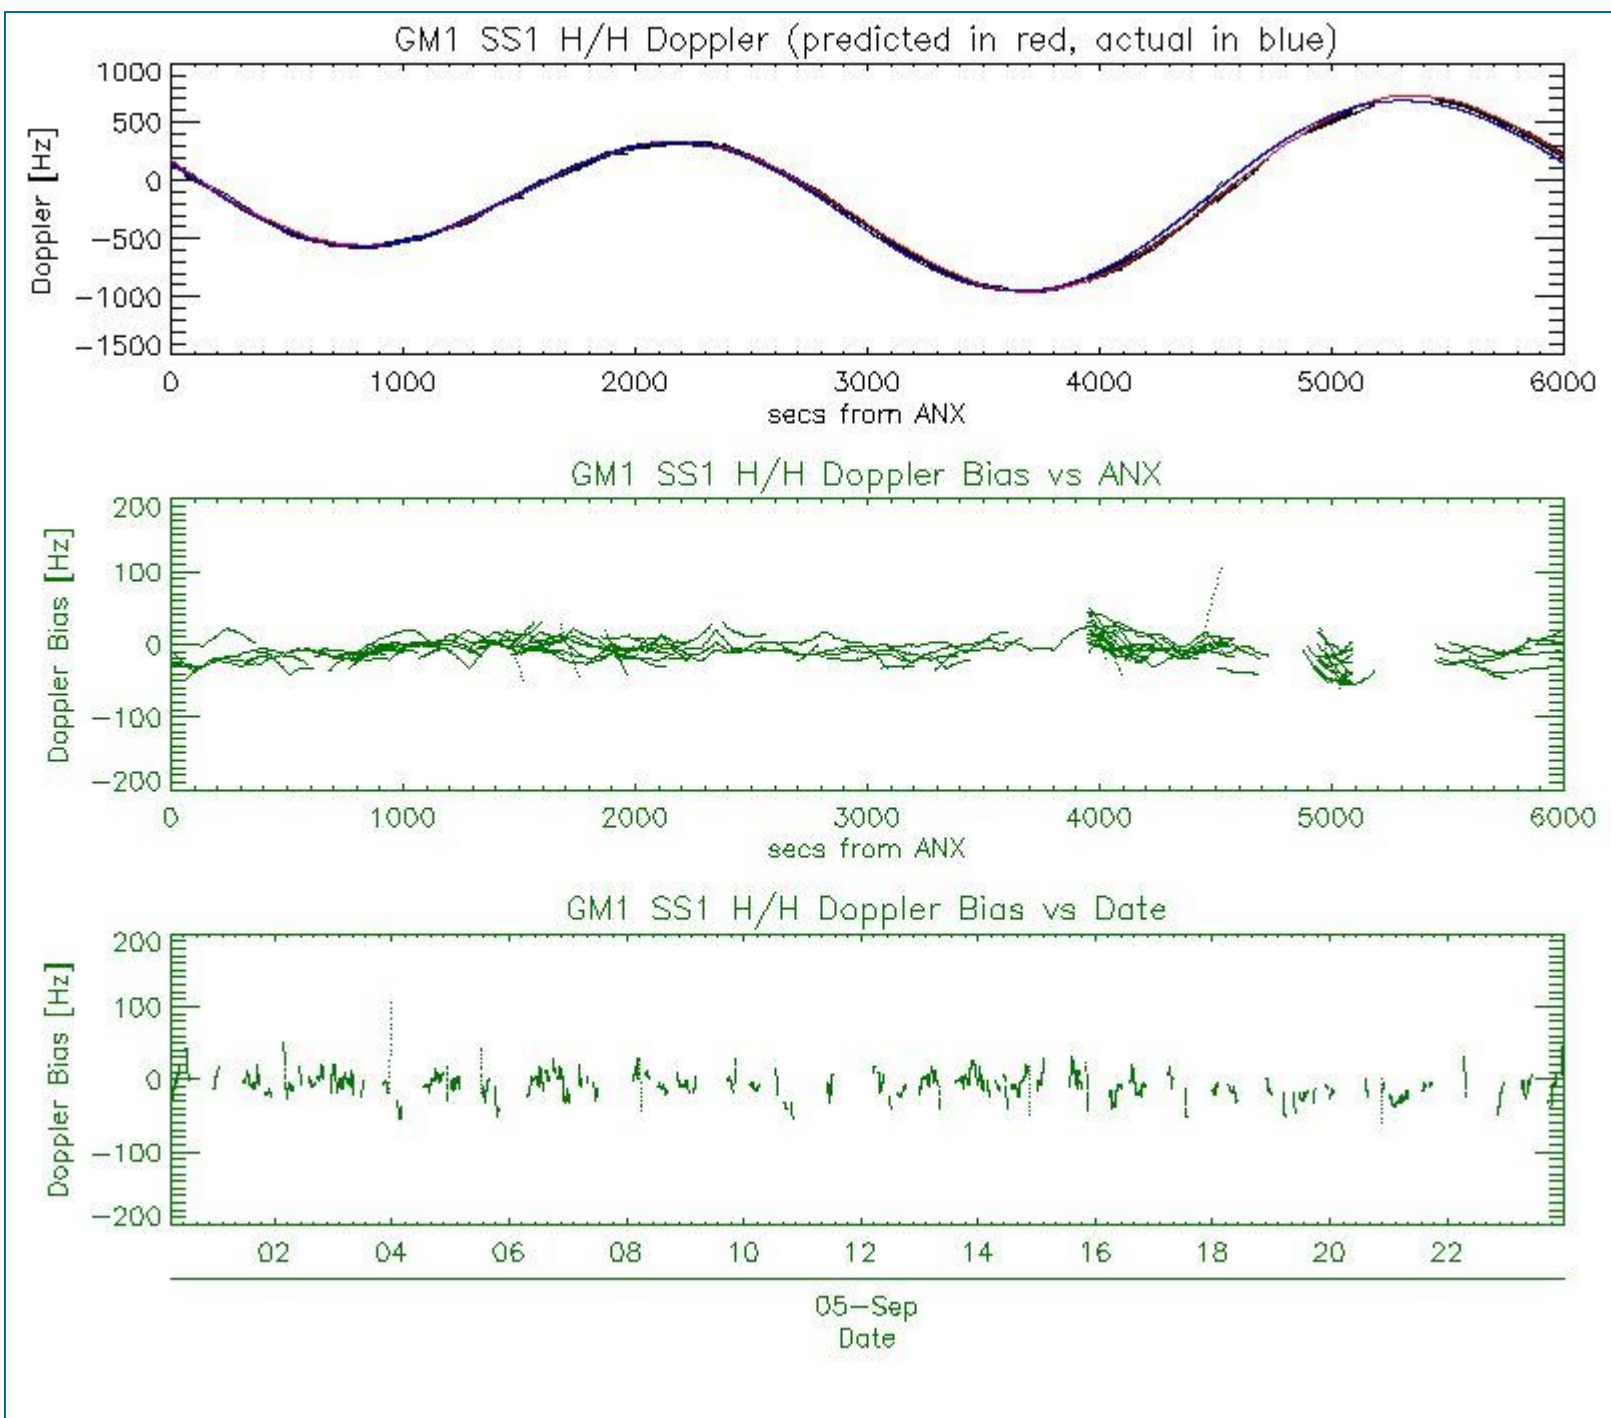


### 5.3 - Doppler JUMPS Analysis for WSM

[ [BACK TO MENU](#) ]





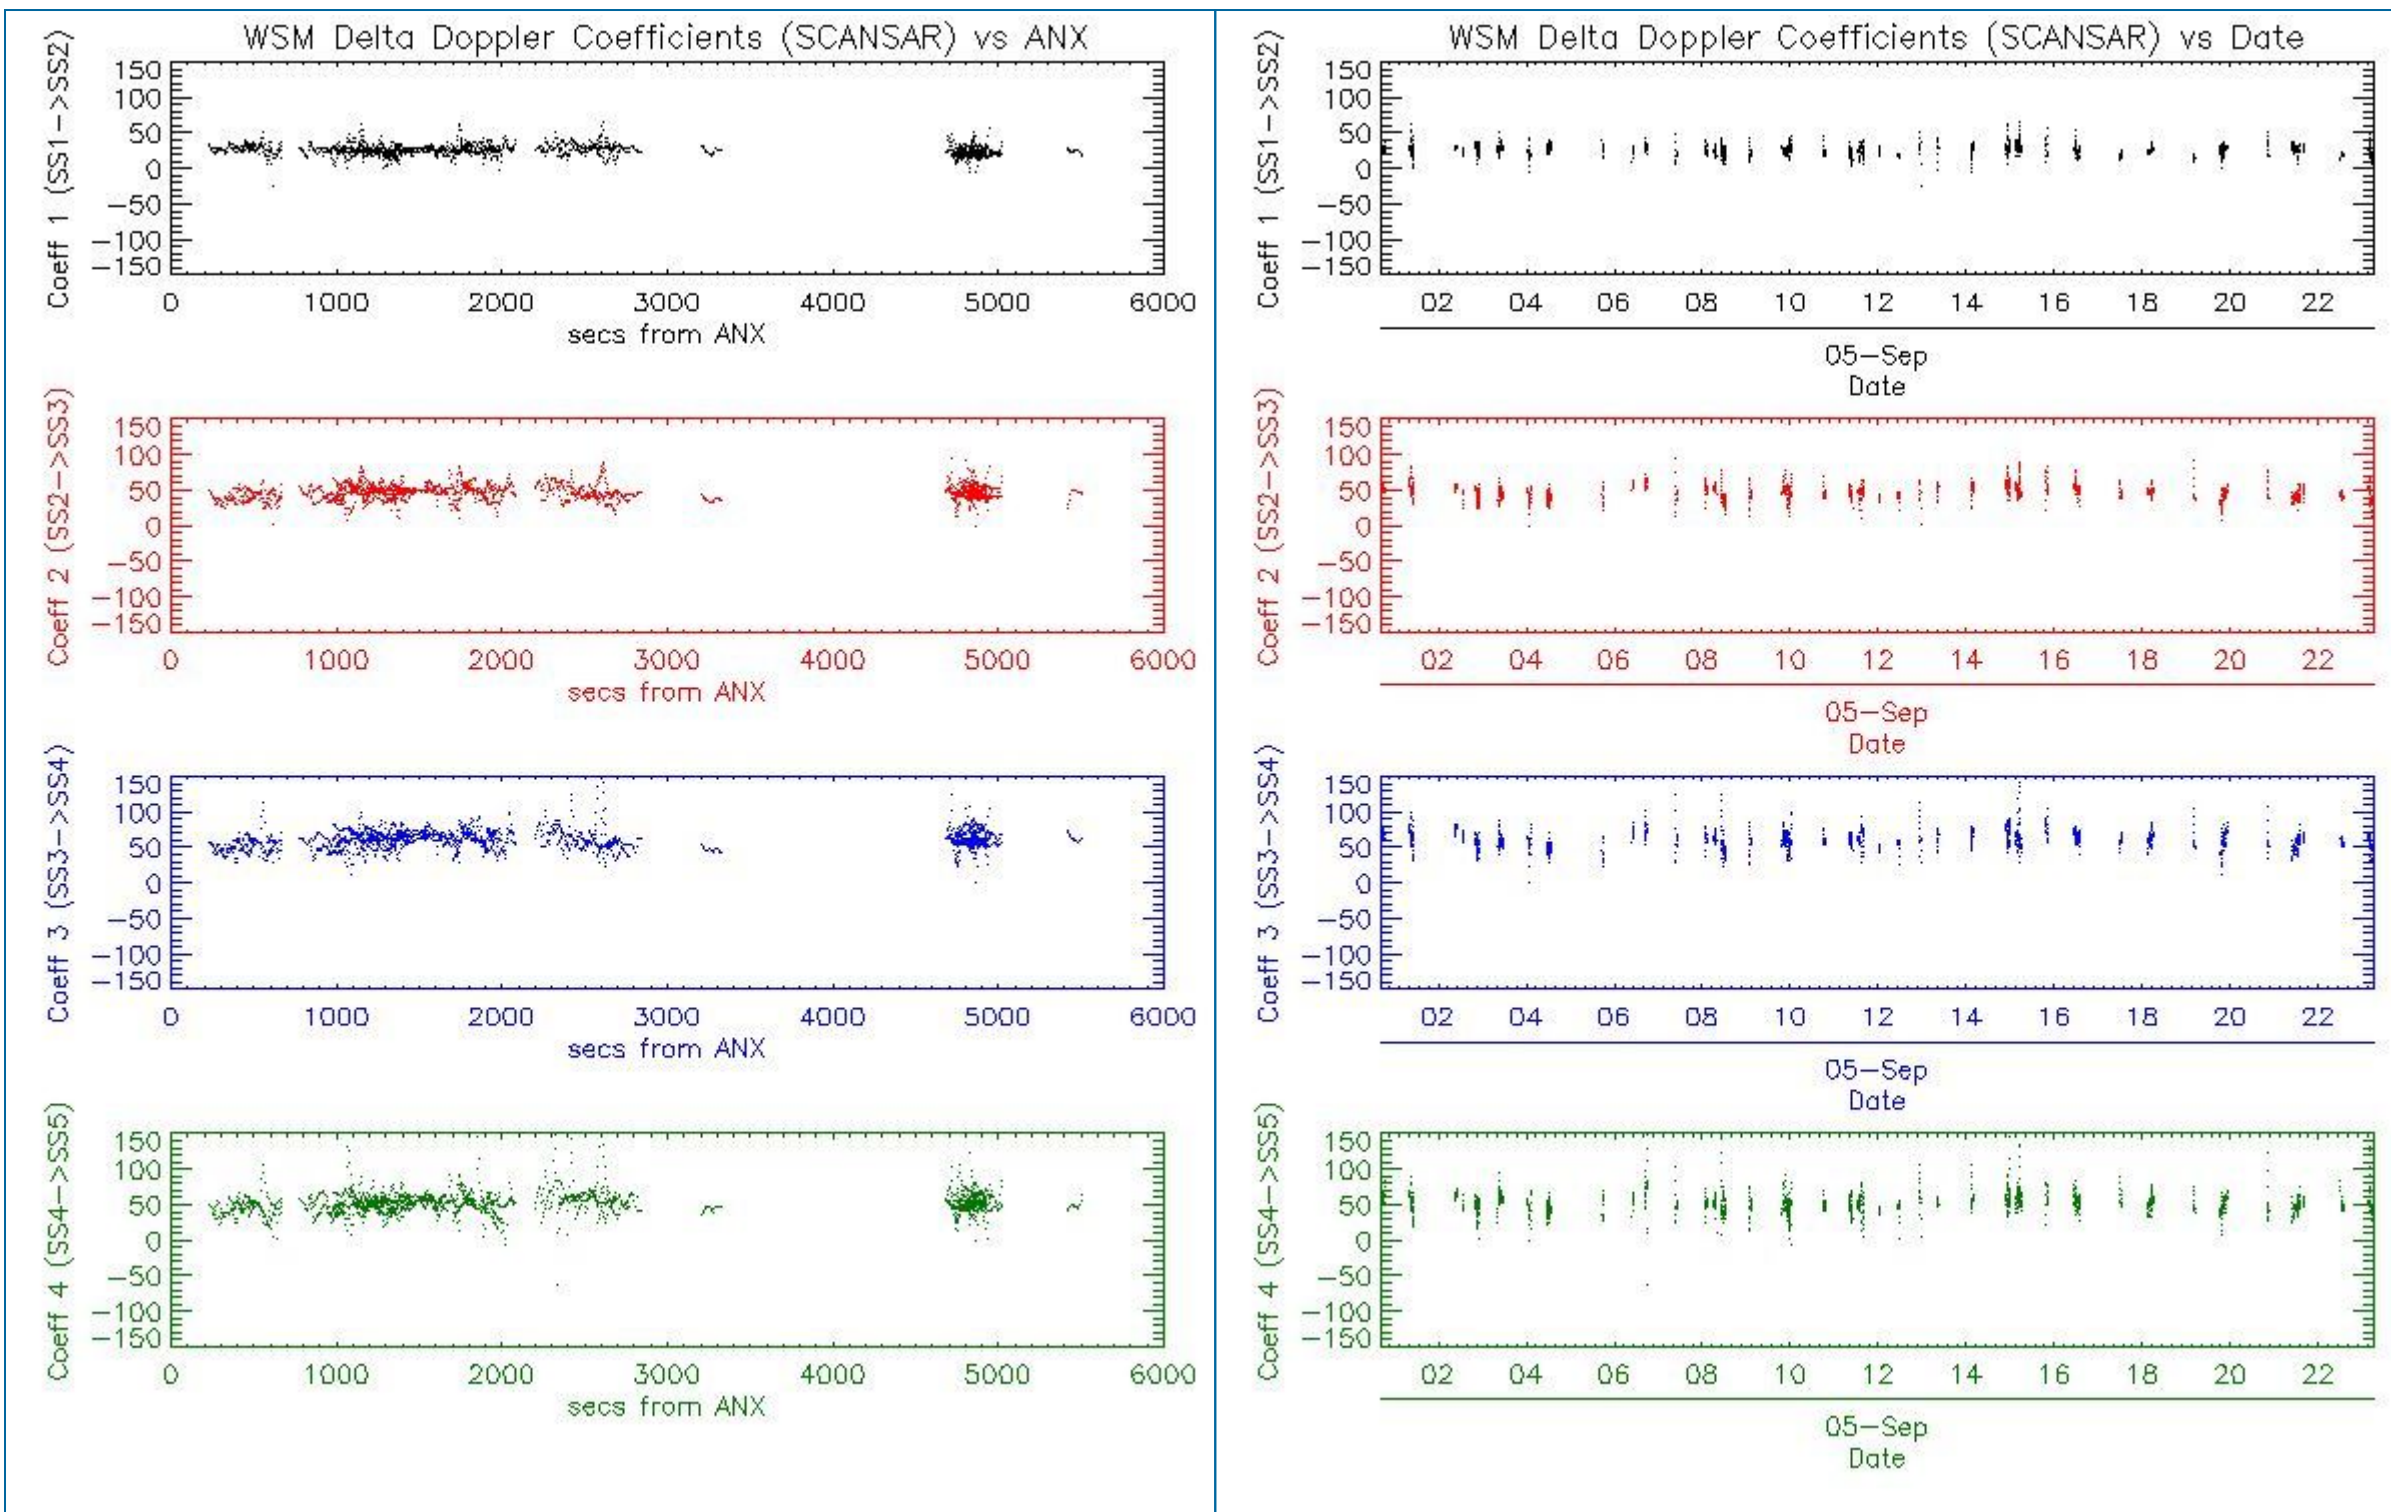



## 6 - CHIRP ANALYSIS

### 6.1 - Analysis for WSM SS1 H/H

#### 6.1.1 - ScaleFactor

[ [BACK TO MENU](#) ]





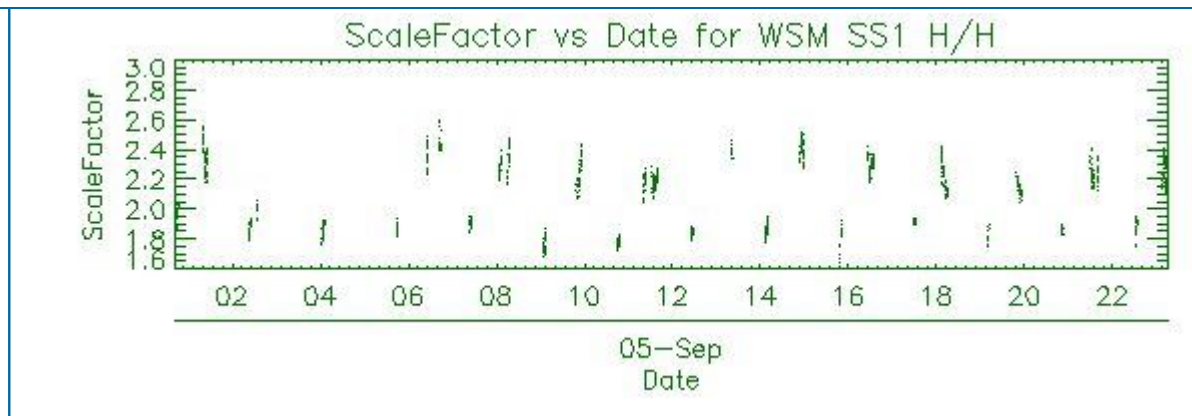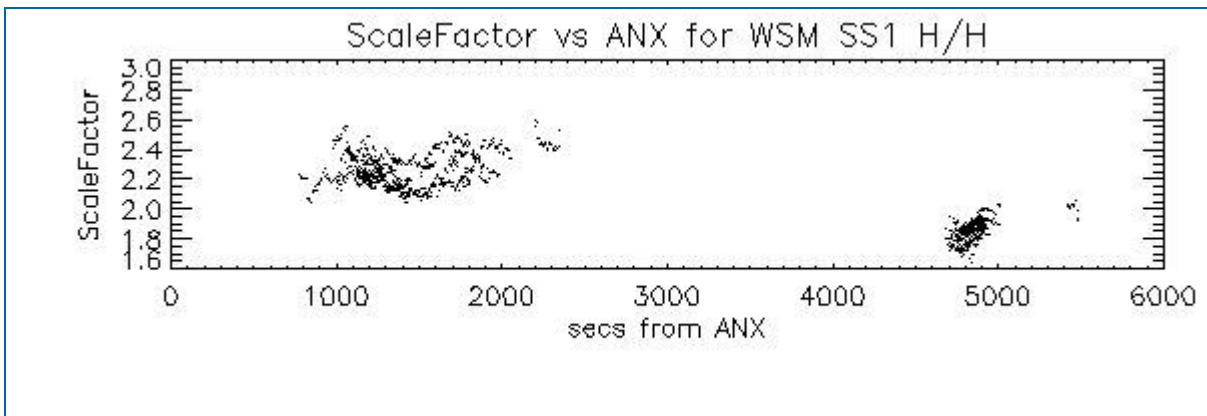

## 6.2 - Analysis for WSM SS1 V/V

### 6.2.1 - ScaleFactor

[ [BACK TO MENU](#) ]

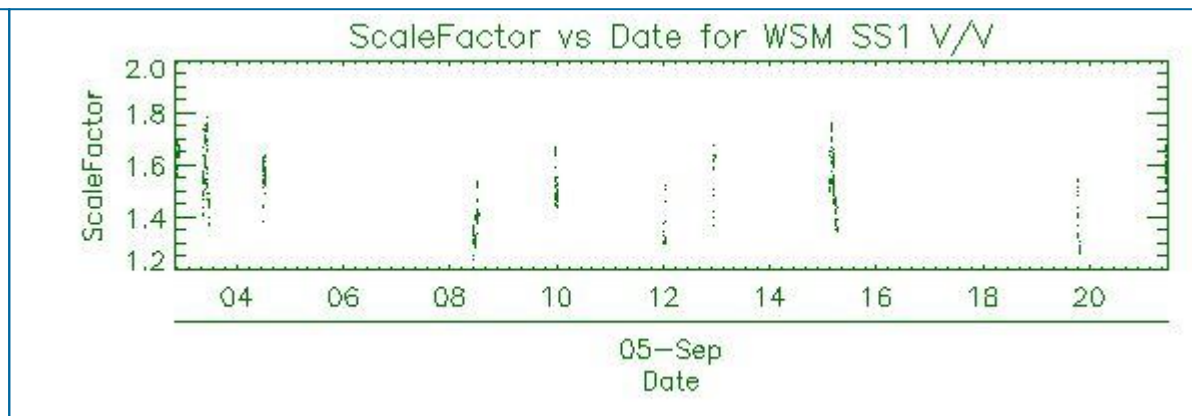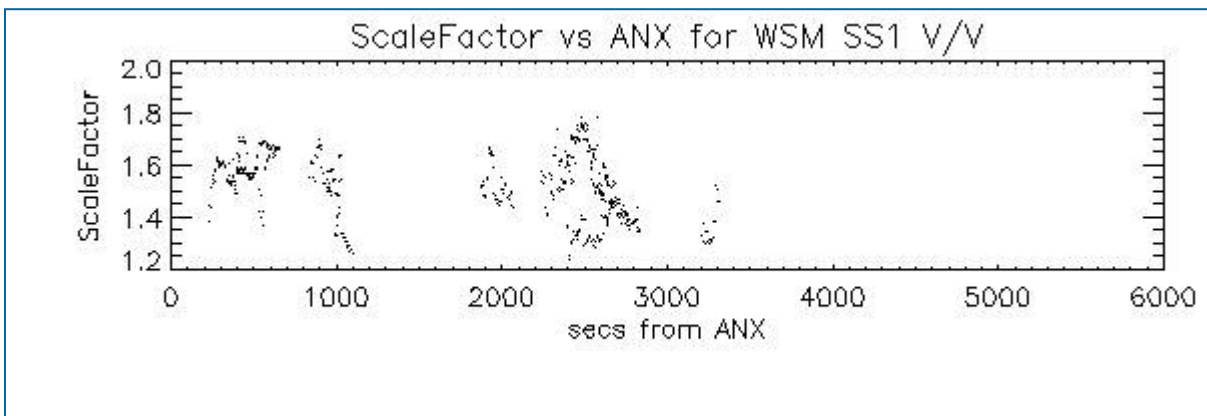




## 7 - RAW DATA ANALYSIS

### 7.1 - Analysis for WVS

[ [BACK TO MENU](#) ]

--	--	--



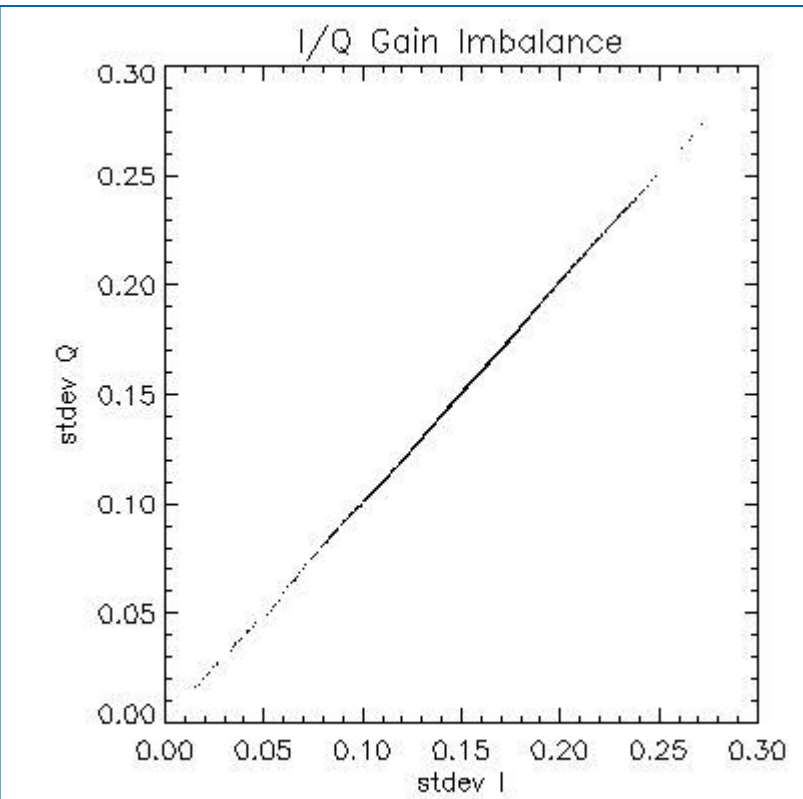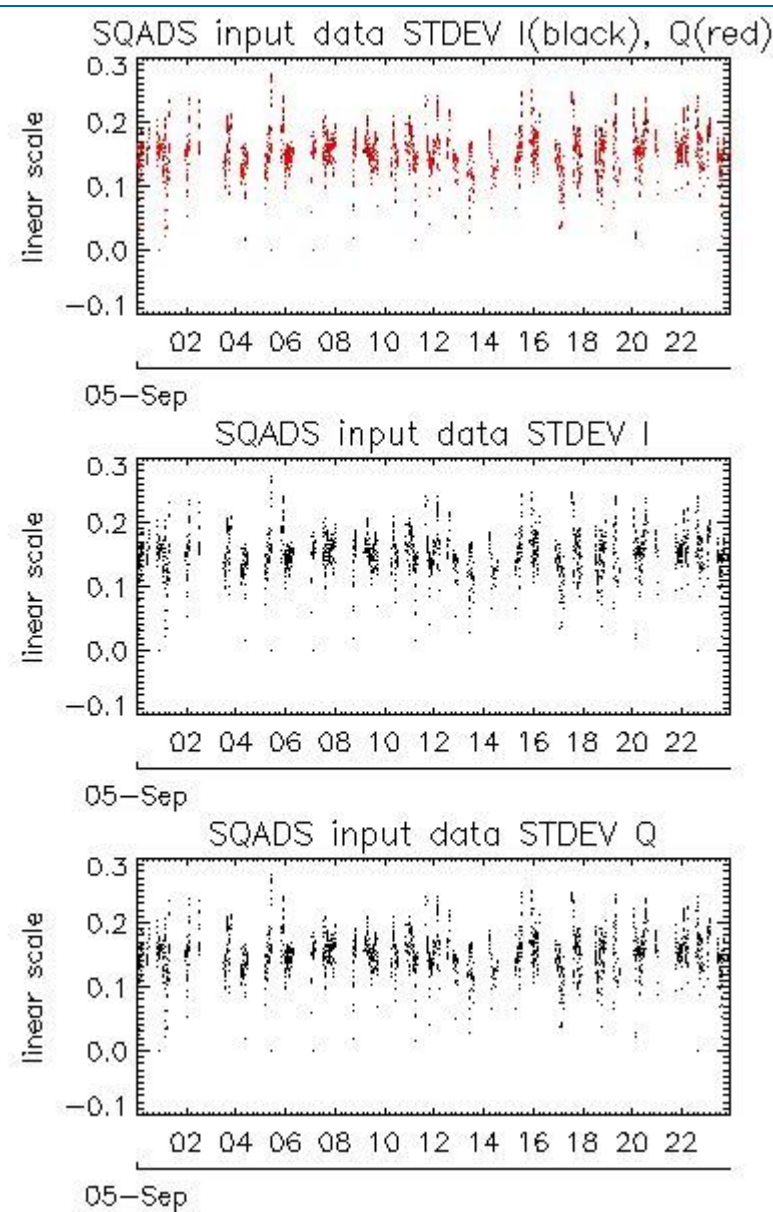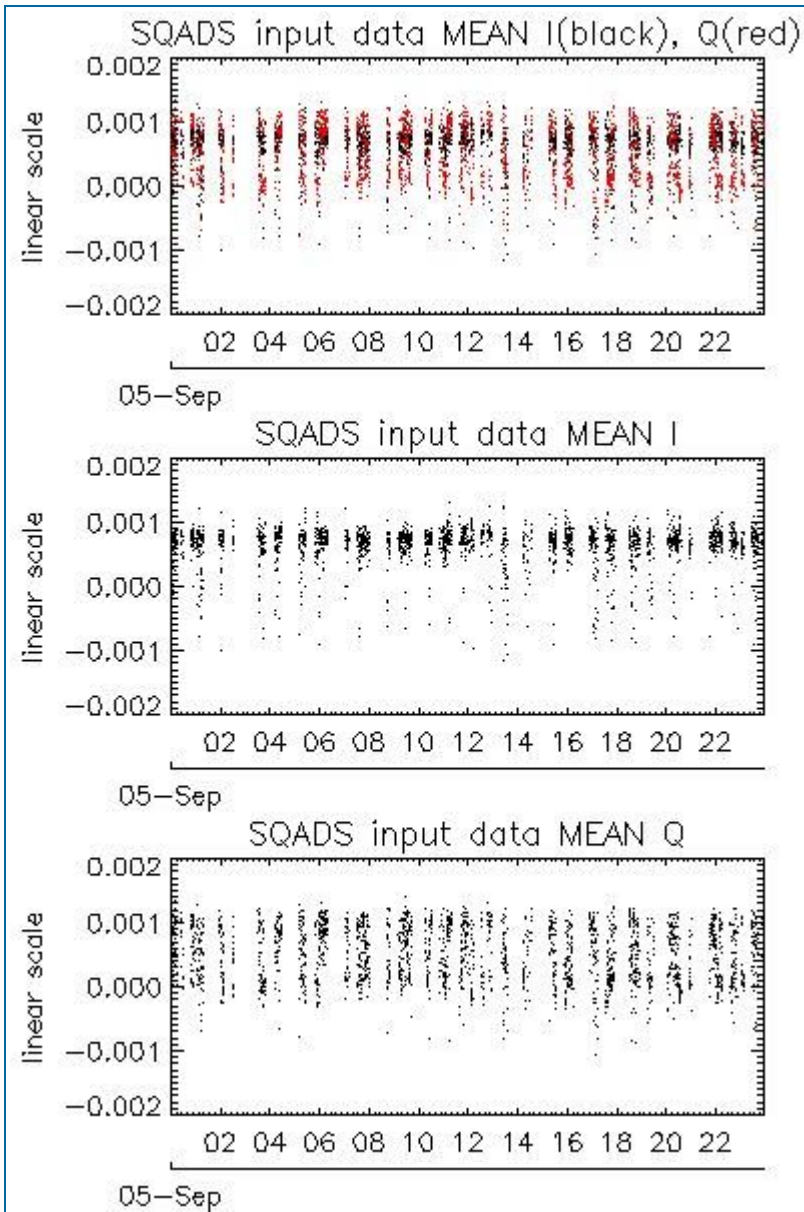


Channel	Statistics	DSS-B
MEAN I	mean	0.000642257
	stdev	9.98855e-08
MEAN Q	mean	0.000527264
	stdev	1.96870e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.151901
	stdev	0.00113631
STDEV Q	mean	0.152451
	stdev	0.00116103

## 7.2 - Analysis for IMM

[ [BACK TO MENU](#) ]



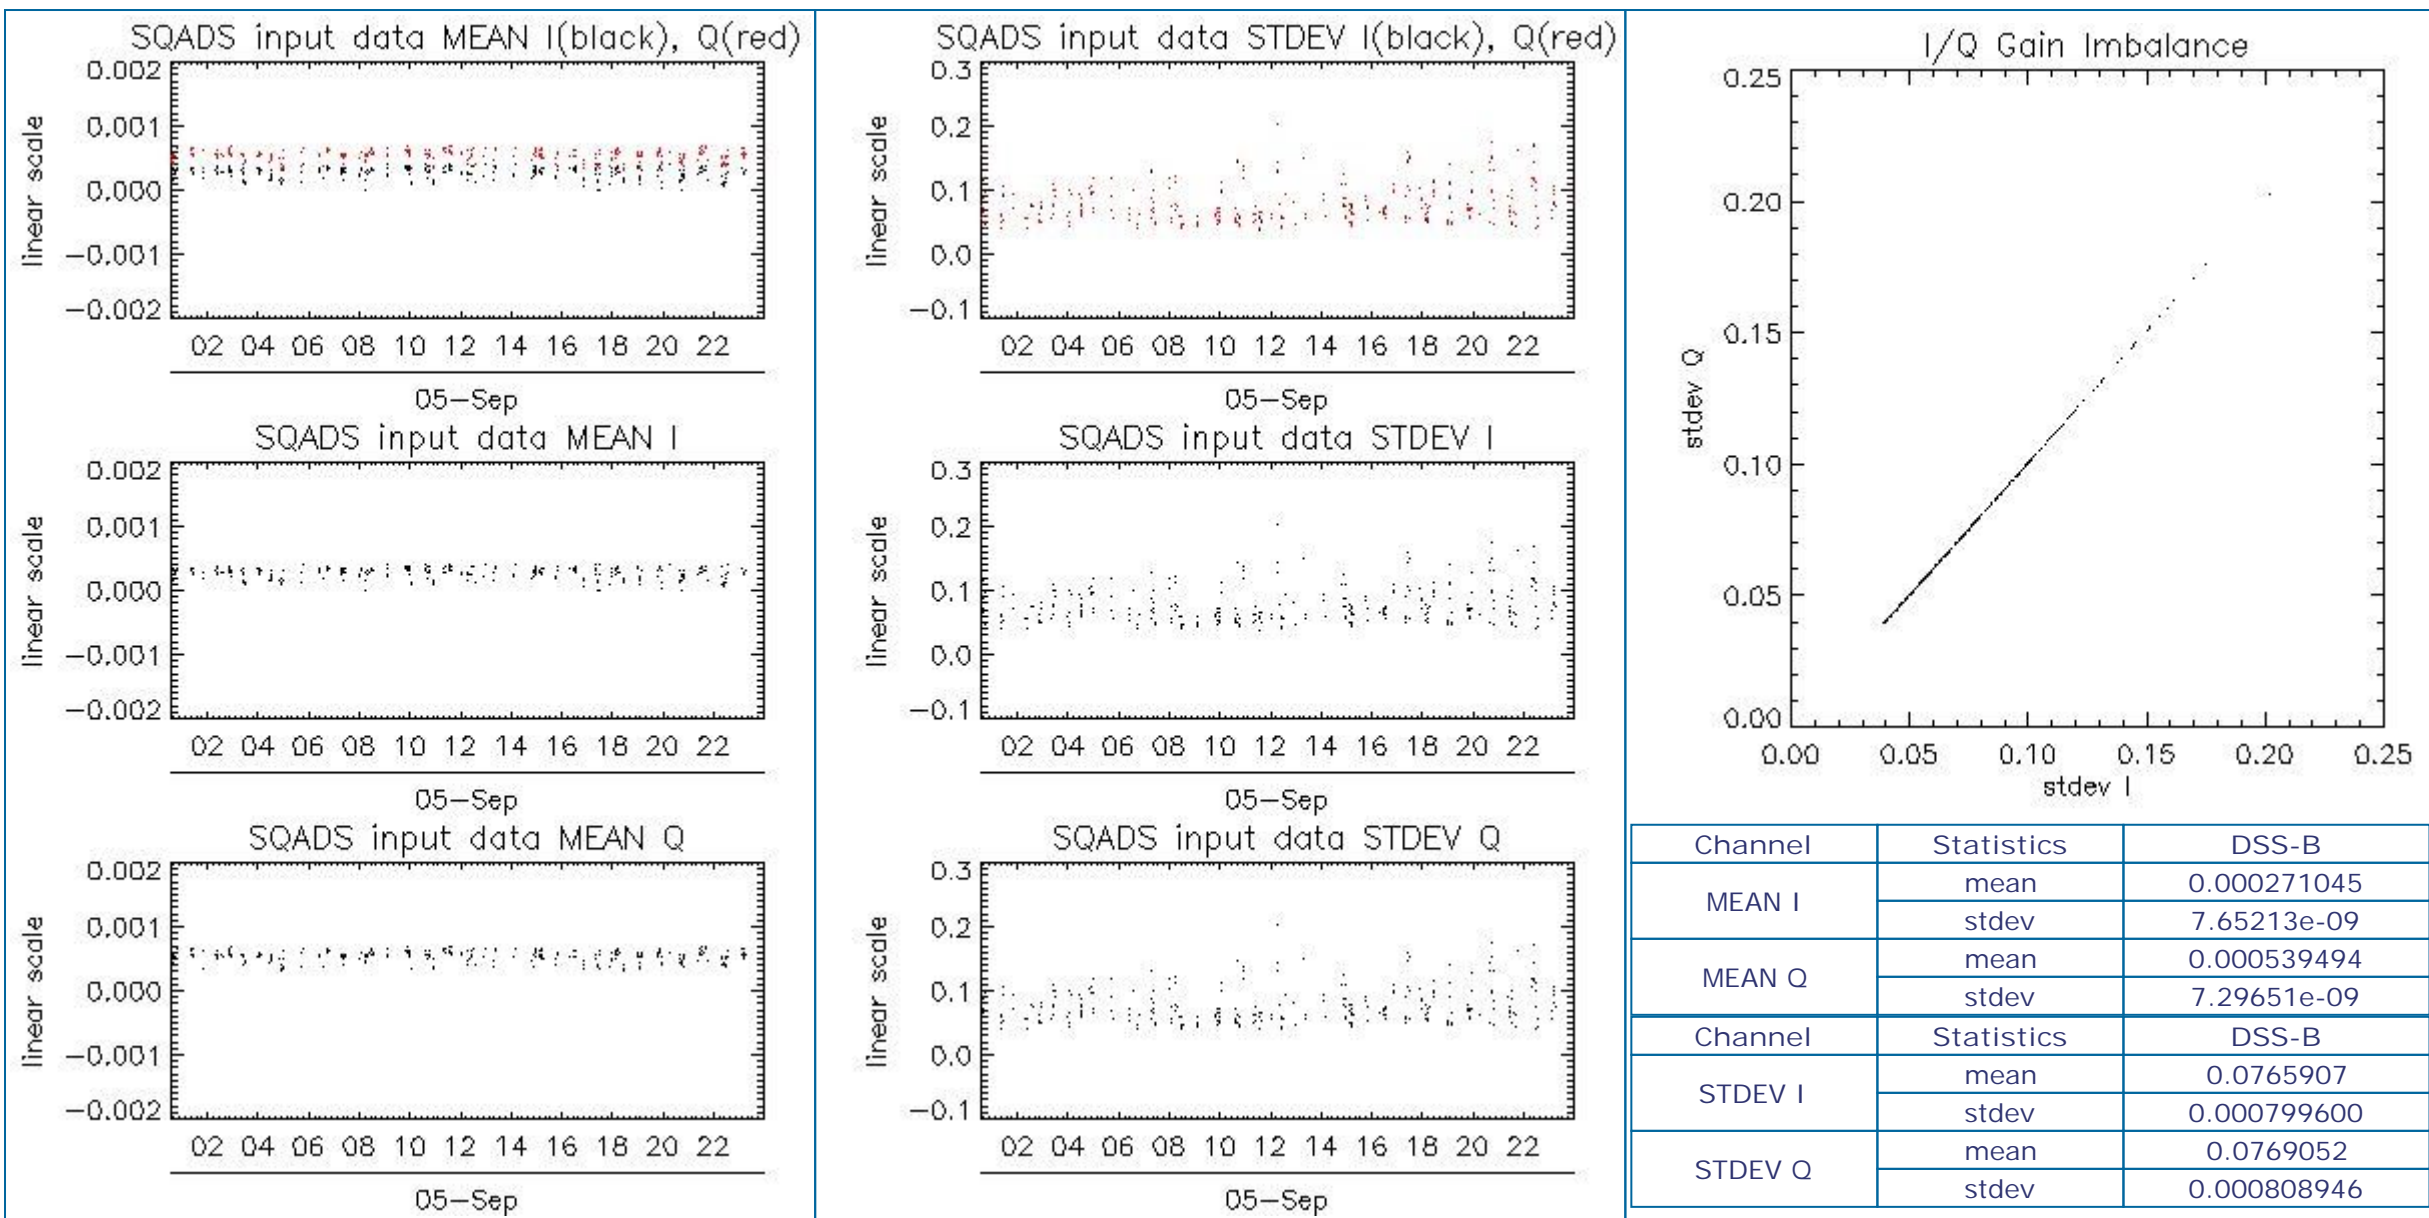


## 8 - TELEMETRY ANALYSIS


Processing Center	Product	Gaps	Missing lines
PDK	ASA_WSM_1PNPDK20100905_042823_000002752092_00377_44519_4751.N1	0	30
PDK	ASA_WSM_1PNPDK20100905_042823_000002752092_00377_44519_4749.N1	0	30

### 8.1 - Number of Missing lines

[ [BACK TO MENU](#) ]






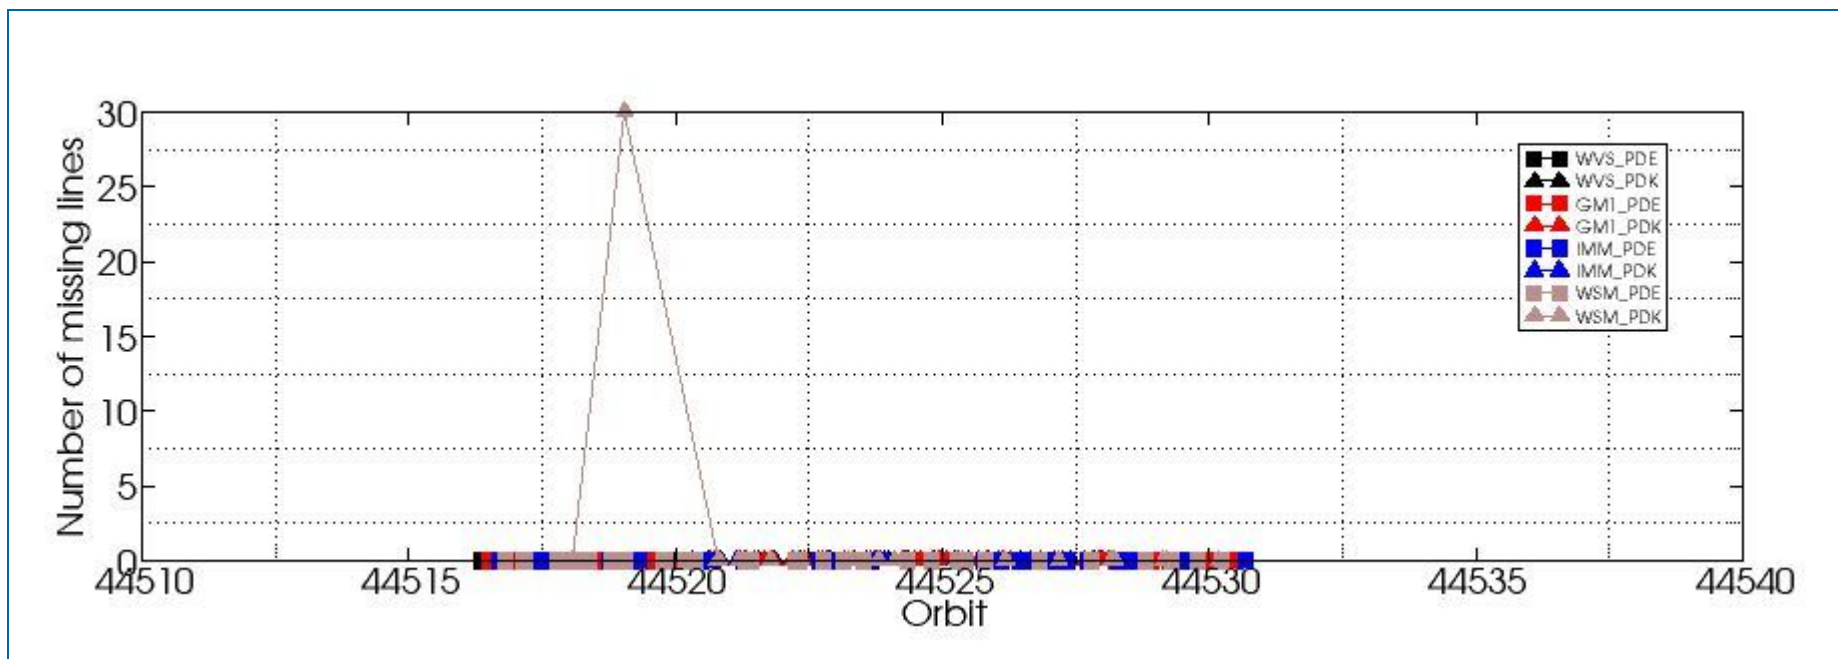

## 8.2 - Number of Gaps

[ [BACK TO MENU](#) ]

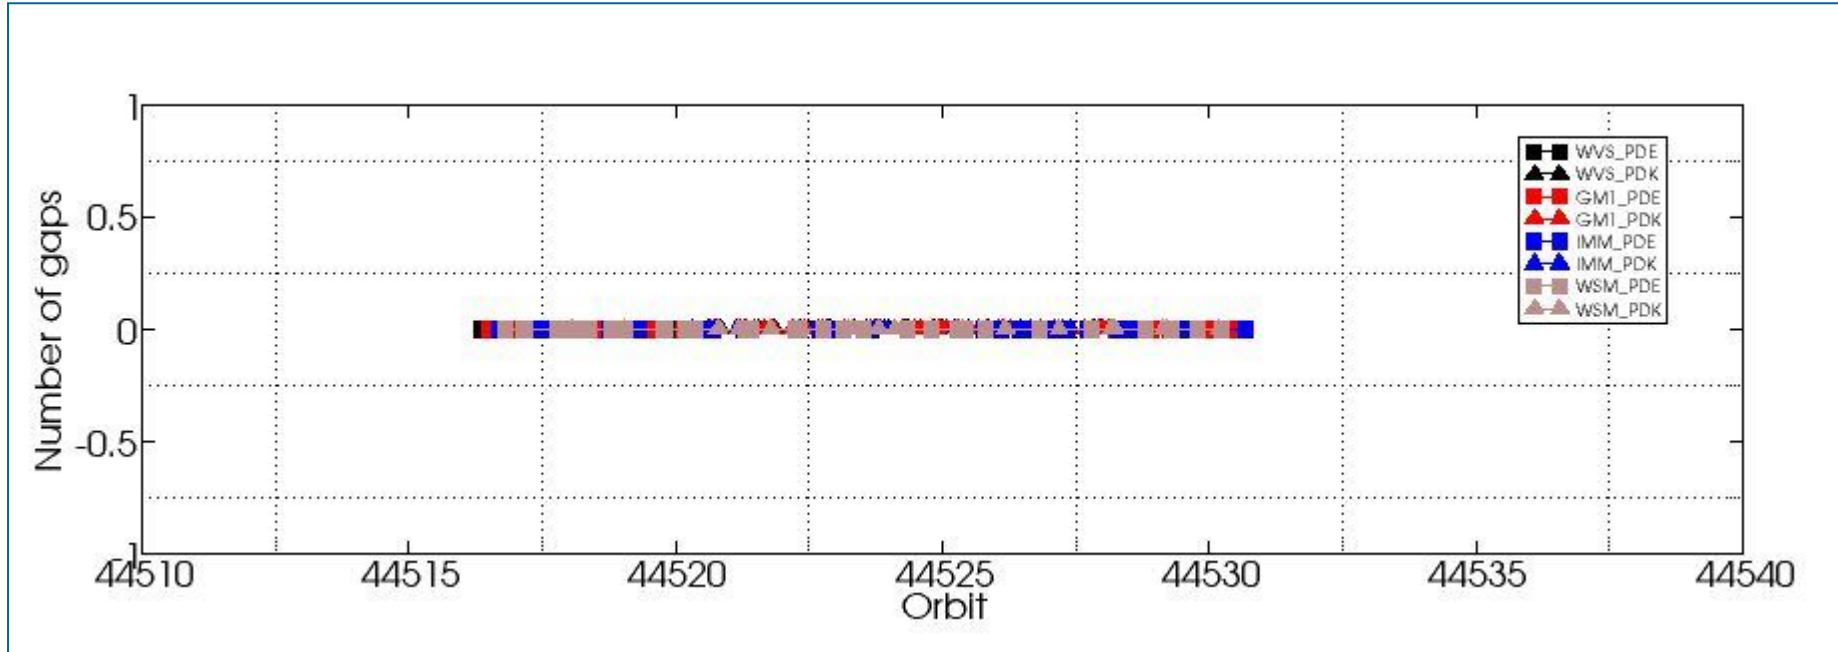

#####  
ASAR DAILY REPORT for 100905  
#####

MODE: DAILY  
ANALYSIS: ALL  
DATE: YESTERDAY

Analysis will be performed from 2010-09-05 00:00:00 to 2010-09-05 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_100905/

DATA SUMMARY

#####  
Summary will be performed from 2010-09-05 00:00:00 to 2010-09-05 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_100905/DATA\_SUMMARY

Creating directory ./RESULTS/DAILY/\_100905/DATA\_SUMMARY...  
Writing file ./RESULTS/DAILY/\_100905/DATA\_SUMMARY/Data\_summary.html...

\*\*\*\*\*  
Getting WVS products list from 2010-09-05 00:00:00 to 2010-09-05 23:59:59...  
Writing file ./RESULTS/DAILY/\_100905/DATA\_SUMMARY/List\_WVS\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_100905/DATA\_SUMMARY/List\_WVS\_products\_used.txt...

\*\*\*\*\*  
Getting GM1 products list from 2010-09-05 00:00:00 to 2010-09-05 23:59:59...  
Writing file ./RESULTS/DAILY/\_100905/DATA\_SUMMARY/List\_GM1\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_100905/DATA\_SUMMARY/List\_GM1\_products\_used.txt...

\*\*\*\*\*  
Getting APM products list from 2010-09-05 00:00:00 to 2010-09-05 23:59:59...  
Writing file ./RESULTS/DAILY/\_100905/DATA\_SUMMARY/List\_APM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_100905/DATA\_SUMMARY/List\_APM\_products\_used.txt...

\*\*\*\*\*  
Getting IMM products list from 2010-09-05 00:00:00 to 2010-09-05 23:59:59...  
Writing file ./RESULTS/DAILY/\_100905/DATA\_SUMMARY/List\_IMM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_100905/DATA\_SUMMARY/List\_IMM\_products\_used.txt...

\*\*\*\*\*  
Getting WSM products list from 2010-09-05 00:00:00 to 2010-09-05 23:59:59...  
Writing file ./RESULTS/DAILY/\_100905/DATA\_SUMMARY/List\_WSM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_100905/DATA\_SUMMARY/List\_WSM\_products\_used.txt...

\*\*\*\*\*  
Getting MS products list from 2010-09-05 00:00:00 to 2010-09-05 23:59:59...  
Writing file ./RESULTS/DAILY/\_100905/DATA\_SUMMARY/List\_MS\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_100905/DATA\_SUMMARY/List\_MS\_products\_used.txt...

DATA SUMMARY completed  
#####

AUXILIARY FILES ANALYSIS

#####  
Analysis will be performed from 2010-09-05 00:00:00 to 2010-09-05 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_100905/AUXILIARY

Creating directory ./RESULTS/DAILY/\_100905/AUXILIARY...

\*\*\*\*\*  
Looking for the IECF operational ADFs list...





ADF filter 20100905\*current\_3\_IECF\_ADFs.txt  
 Found list 20100905\_030003\_current\_3\_IECF\_ADFs.txt...  
 Extracting ADFs...

ASA\_CON\_AXVIEC20100608\_125449\_20100317\_120410\_20101231\_000000  
 ASA\_INS\_AXVIEC20091217\_114637\_20090428\_100000\_20101231\_235959  
 ASA\_XCH\_AXVIEC20091217\_113006\_20020301\_000000\_20101231\_000000  
 ASA\_XCA\_AXVIEC20100608\_123419\_20100317\_120410\_20110101\_000000

Writing file ./RESULTS/DAILY/\_100905/AUXILIARY/ASAR\_ADFs\_IECF\_List3.html...  
 Writing file ./RESULTS/DAILY/\_100905/AUXILIARY/Auxiliary\_files\_summary.html...

\*\*\*\*\*

Analysing WVS products...

Writing file ./RESULTS/DAILY/\_100905/AUXILIARY/Check\_ADFs\_WVS.xls...  
 Writing file ./RESULTS/DAILY/\_100905/AUXILIARY/Check\_ADFs\_WVS.txt...

ASA_WVS_1PNPDE20100905_002256_000003002092_00374_44516_0183.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_004734_000003142092_00374_44516_0184.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_005204_000003142092_00374_44516_0203.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_010244_000009292092_00374_44516_0206.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_015627_000007192092_00375_44517_0209.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_022819_000002252092_00375_44517_0225.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_033039_000000742092_00376_44518_0216.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_033039_000000742092_00376_44518_0223.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_033139_000009292092_00376_44518_0247.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_041033_000010192092_00376_44518_0254.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_050956_000010042092_00377_44519_0252.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_052610_00000302092_00377_44519_0281.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_054931_000017392092_00377_44519_0292.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_070244_000002552092_00378_44520_0291.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_200334_000006142092_00386_44528_0373.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_201523_000011842092_00386_44528_0376.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_205454_000003002092_00386_44528_0392.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_214354_00000602092_00387_44529_0395.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_214620_000017692092_00387_44529_0397.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_223521_000002242092_00387_44529_0398.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_223806_000007942092_00387_44529_0413.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_230111_000003602092_00388_44530_0420.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_232618_000009142092_00388_44530_0416.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20100905_235228_000002252092_00388_44530_0422.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_070629_000002252092_00378_44520_4765.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_073007_000017992092_00378_44520_4768.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_084217_000005242092_00379_44521_4795.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_091043_000019342092_00379_44521_4799.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_101541_000009442092_00380_44522_4825.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_105119_000001802092_00380_44522_4824.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_105717_000013192092_00380_44522_4827.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_114024_000010792092_00381_44523_4859.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_120432_000004502092_00381_44523_4864.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_123155_000002552092_00381_44523_4865.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_124644_000005442092_00381_44523_4867.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_132213_000007792092_00382_44524_4895.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_141230_000003152092_00382_44524_4894.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_142252_00000892092_00382_44524_4892.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_143003_000001192092_00383_44525_4898.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_143003_000001192092_00383_44525_4900.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_151539_000010642092_00383_44525_4923.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_155306_000012142092_00383_44525_4927.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_165404_000011842092_00384_44526_4954.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_173342_000013042092_00384_44526_4956.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_182906_000015292092_00385_44527_4983.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_191418_000004502092_00385_44527_4984.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20100905_192525_000001642092_00385_44527_4987.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

\*\*\*\*\*

Analysing GM1 products...

Writing file ./RESULTS/DAILY/\_100905/AUXILIARY/Check\_ADFs\_GM1.xls...

Writing file ./RESULTS/DAILY/\_100905/AUXILIARY/Check\_ADFs\_GM1.txt...

ASA_GM1_1PNPDE20100905_001402_000005312092_00374_44516_0182.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_002839_000002832092_00374_44516_0185.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_005803_000002772092_00374_44516_0204.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_012704_000010152092_00375_44517_0205.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_015030_000003562092_00375_44517_0207.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_020916_000006282092_00375_44517_0208.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_022542_000001502092_00375_44517_0211.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_023515_000003502092_00375_44517_0210.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_024235_000004532092_00375_44517_0212.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_025655_000004652092_00376_44518_0213.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_030527_000009432092_00376_44518_0226.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_032855_000000962092_00376_44518_0217.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_032855_000000962092_00376_44518_0224.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_035142_000004652092_00376_44518_0249.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_040604_000002652092_00376_44518_0248.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_043302_000011482092_00377_44519_0256.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_045546_000000842092_00377_44519_0255.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_050032_000005612092_00377_44519_0253.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_053029_000000782092_00377_44519_0279.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_053314_000004412092_00377_44519_0280.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_054551_000002172092_00377_44519_0282.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_061908_000003142092_00378_44520_0283.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_062701_000004712092_00378_44520_0297.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_063607_000003322092_00378_44520_0296.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_064449_000001872092_00378_44520_0295.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_064859_000004652092_00378_44520_0294.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_065743_000002952092_00378_44520_0293.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_195557_000001082092_00386_44528_0372.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_195955_000002172092_00386_44528_0374.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_203554_000002292092_00386_44528_0377.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_205249_000000662092_00386_44528_0378.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_205251_000001142092_00386_44528_0391.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_210042_000011842092_00386_44528_0394.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_213458_000002292092_00387_44529_0393.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_214124_000001442092_00387_44529_0396.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_221627_000001812092_00387_44529_0399.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_225212_000003562092_00388_44530_0414.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_231545_000006282092_00388_44530_0419.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_234207_000001442092_00388_44530_0418.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_234602_000002892092_00388_44530_0417.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_235057_000000842092_00388_44530_0421.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20100905_235701_000001502092_00388_44530_0424.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_071106_000002292092_00378_44520_4764.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_071859_000001022092_00378_44520_4766.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_072647_000001992092_00378_44520_4767.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_080723_000003022092_00379_44521_4769.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_081344_000000842092_00379_44521_4791.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_081918_000002172092_00379_44521_4792.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_083213_000006042092_00379_44521_4793.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_085140_000007432092_00379_44521_4794.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_090803_000001572092_00379_44521_4796.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_094340_000003082092_00380_44522_4797.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_095032_000001202092_00380_44522_4800.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_100654_000005252092_00380_44522_4821.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_103215_000001692092_00380_44522_4823.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_104128_000001812092_00380_44522_4822.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_104825_000001692092_00380_44522_4826.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_112451_000004282092_00381_44523_4828.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_121255_000001262092_00381_44523_4860.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_121754_000003202092_00381_44523_4863.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK



ASA_GM1_1PNPDK20100905_122922_000001502092_00381_44523_4862.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_123804_000005192092_00381_44523_4866.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_125912_000009062092_00382_44524_4869.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_131337_000002472092_00382_44524_4887.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_131915_00000722092_00382_44524_4888.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_133557_000006772092_00382_44524_4889.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_134720_000011482092_00382_44524_4890.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_140955_000001502092_00382_44524_4891.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_141823_000002652092_00382_44524_4896.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_142459_000003022092_00382_44524_4893.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_143425_000009852092_00383_44525_4899.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_143425_000009852092_00383_44525_4901.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_145221_00000722092_00383_44525_4921.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_150001_000004222092_00383_44525_4922.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_153404_000007012092_00383_44525_4924.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_155039_000001442092_00383_44525_4925.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_161410_000002892092_00384_44526_4926.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_162007_000003862092_00384_44526_4928.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_163546_000009552092_00384_44526_4952.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_171439_000002952092_00384_44526_4953.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_173140_000001142092_00384_44526_4955.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_175945_000003802092_00385_44527_4957.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_181556_000005432092_00385_44527_4980.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_185513_000002652092_00385_44527_4981.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_191146_000001502092_00385_44527_4982.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_192234_000001692092_00385_44527_4985.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_192857_000005012092_00385_44527_4986.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20100905_194248_000001632092_00386_44528_4988.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

\*\*\*\*\*

Analysing APM products...

No APM products available for the selected period...

\*\*\*\*\*

Analysing IMM products...

Writing file ./RESULTS/DAILY/\_100905/AUXILIARY/Check\_ADFs\_IMM.xls...

Writing file ./RESULTS/DAILY/\_100905/AUXILIARY/Check\_ADFs\_IMM.txt...

ASA_IMM_1PNPDE20100905_003324_000004432092_00374_44516_0177.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_014824_000001132092_00375_44517_0200.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_021946_00000922092_00375_44517_0201.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_035927_00000922092_00376_44518_0239.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_045211_000002032092_00377_44519_0237.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_045713_000001892092_00377_44519_0238.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_054031_000001622092_00377_44519_0276.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_064755_000000512092_00378_44520_0275.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_071455_000002322092_00378_44520_0288.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_081225_000000682092_00379_44521_0318.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_103505_000003732092_00380_44522_0330.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_105449_000001422092_00380_44522_0341.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_121501_000001622092_00381_44523_0344.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_154543_00000922092_00383_44525_0355.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_161900_000000592092_00384_44526_0361.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_165140_000001392092_00384_44526_0364.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_171933_000003022092_00384_44526_0365.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_172523_000001942092_00384_44526_0362.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_175602_000000372092_00385_44527_0366.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_175702_000001552092_00385_44527_0367.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_182500_000002392092_00385_44527_0370.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_185938_000003022092_00385_44527_0371.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_190528_000001622092_00385_44527_0368.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_195749_000001142092_00386_44528_0387.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_201433_000000442092_00386_44528_0389.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

```
ASA_IMM_1PNPDE20100905_203944_000003022092_00386_44528_0388.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_204534_000002332092_00386_44528_0375.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_214535_000000392092_00387_44529_0409.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_221928_000002322092_00387_44529_0408.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_222408_000003032092_00387_44529_0390.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20100905_235930_000000912092_00388_44530_0432.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20100905_063448_000000632092_00378_44520_4752.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20100905_072045_000001622092_00378_44520_4778.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20100905_080050_000000922092_00379_44521_4780.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20100905_100115_000000972092_00380_44522_4809.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20100905_122311_000000922092_00381_44523_4861.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20100905_123718_000000372092_00381_44523_4877.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20100905_131742_000000822092_00382_44524_4880.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20100905_145047_000000832092_00383_44525_4897.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

\*\*\*\*\*

Analysing WSM products...

Writing file ./RESULTS/DAILY/\_100905/AUXILIARY/Check\_ADFs\_WSM.xls...

Writing file ./RESULTS/DAILY/\_100905/AUXILIARY/Check\_ADFs\_WSM.txt...

```
ASA_WSM_1PNPDE20100905_004158_000002812092_00374_44516_0189.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_011943_000004282092_00375_44517_0199.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_022230_000001842092_00375_44517_0202.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_023341_000000922092_00375_44517_0230.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_025135_000002202092_00376_44518_0234.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_032118_000004532092_00376_44518_0215.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_032118_000004532092_00376_44518_0222.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_040159_000002452092_00376_44518_0240.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_042854_000002452092_00377_44519_0241.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_054328_000001282092_00377_44519_0277.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_062426_000001472092_00378_44520_0278.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_064148_000001772092_00378_44520_0274.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_081520_000002322092_00379_44521_0319.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_082542_000003852092_00379_44521_0320.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_095243_000002392092_00380_44522_0327.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_095737_000002142092_00380_44522_0328.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_104434_000002262092_00380_44522_0340.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_111957_000002882092_00381_44523_0342.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_120028_000001222092_00381_44523_0343.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_132039_000000922092_00382_44524_0357.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_140635_000001842092_00382_44524_0358.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_145644_000001842092_00383_44525_0359.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_151038_000001592092_00383_44525_0360.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_154836_000001222092_00383_44525_0356.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_172925_000001282092_00384_44526_0363.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_190926_000001282092_00385_44527_0369.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_205027_000001282092_00386_44528_0386.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_213853_000001472092_00387_44529_0402.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_223018_000002452092_00387_44529_0407.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20100905_231300_000001592092_00388_44530_0431.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_025016_000003002092_00376_44518_4737.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_025016_000003002092_00376_44518_4750.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_042823_000002752092_00377_44519_4749.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_042823_000002752092_00377_44519_4751.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_072343_000001772092_00378_44520_4779.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_080343_000002142092_00379_44521_4781.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_090408_000002322092_00379_44521_4807.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_094853_000000922092_00380_44522_4810.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_095747_000000982092_00380_44522_4811.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_113208_000003062092_00381_44523_4837.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_113806_000001282092_00381_44523_4840.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_122534_000002262092_00381_44523_4868.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_125626_000000862092_00382_44524_4879.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_145345_000002812092_00383_44525_4908.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_150710_000005082092_00383_44525_4938.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```



```
ASA_WSM_1PNPDK20100905_162637_000005442092_00384_44526_4937.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_180609_000005812092_00385_44527_4967.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_194539_000001772092_00386_44528_4995.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_194901_000000862092_00386_44528_4996.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_195105_000002882092_00386_44528_4999.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_212431_000002202092_00387_44529_5022.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_212941_000003062092_00387_44529_5024.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20100905_230757_000003552092_00388_44530_5030.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

AUXILIARY FILES ANALYSIS completed

#####

MODULE STEPPING ANALYSIS

#####

Analysis will be performed from 2010-09-05 00:00:00 to 2010-09-05 23:59:59

Results will be exported to the directory: ./RESULTS/DAILY/\_100905/MODULE\_STEPPING

Creating directory ./RESULTS/DAILY/\_100905/MODULE\_STEPPING...

Creating directory ./RESULTS/DAILY/\_100905/MODULE\_STEPPING/FIRST\_REFERENCE...

Creating directory ./RESULTS/DAILY/\_100905/MODULE\_STEPPING/SECOND\_REFERENCE...

Creating directory ./RESULTS/DAILY/\_100905/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE...

Deleting old files...

\*\*\*\*\*

\*\*\*\*\*

Creating images comparing with second reference...

Exporting results to the directory ../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/SECOND\_REFERENCE...

Polarization: H

Reference product: ASA\_MS\_0PNPDK20010209\_135042\_0000009A024\_00180\_11700\_0052.N1

Test product: ASA\_MS\_0PNPDK20100904\_060333\_000000162092\_00363\_44505\_0197.N1

H

H

../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/SECOND\_REFERENCE/TGH\_20100904\_060333-20010209\_135042.png

../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/SECOND\_REFERENCE/TPH\_20100904\_060333-20010209\_135042.png

../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/SECOND\_REFERENCE/RGH\_20100904\_060333-20010209\_135042.png

../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/SECOND\_REFERENCE/RPH\_20100904\_060333-20010209\_135042.png

Polarization: V

Reference product: ASA\_MS\_0PNPDK20010209\_140823\_0000009A024\_00180\_11700\_0054.N1

Test product: ASA\_MS\_0PNPDE20100905\_053156\_000000162092\_00377\_44519\_0563.N1

V

V

../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/SECOND\_REFERENCE/TGV\_20100905\_053156-20010209\_140823.png

../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/SECOND\_REFERENCE/TPV\_20100905\_053156-20010209\_140823.png

../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/SECOND\_REFERENCE/RGV\_20100905\_053156-20010209\_140823.png

../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/SECOND\_REFERENCE/RPV\_20100905\_053156-20010209\_140823.png

\*\*\*\*\*

\*\*\*\*\*

Creating images comparing with previous product reference...

Exporting results to the directory ../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE...

Polarization: H

Reference product: ASA\_MS\_0PNPDK20100902\_070647\_000000162092\_00335\_44477\_0195.N1

Test product: ASA\_MS\_0PNPDK20100904\_060333\_000000162092\_00363\_44505\_0197.N1

H

H

../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TGH\_20100904\_060333-20100902\_070647.png

../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TPH\_20100904\_060333-20100902\_070647.png

../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RGH\_20100904\_060333-20100902\_070647.png

../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RPH\_20100904\_060333-20100902\_070647.png

Polarization: V  
Reference product: ASA\_MS\_0PNPDK20100903\_063510\_000000162092\_00349\_44491\_0196.N1  
Test product: ASA\_MS\_0PNPDE20100905\_053156\_000000162092\_00377\_44519\_0563.N1

V  
V

../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TGV\_20100905\_053156-20100903\_063510.png  
../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TPV\_20100905\_053156-20100903\_063510.png  
../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RGV\_20100905\_053156-20100903\_063510.png  
../../RESULTS/DAILY/\_100905/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RPV\_20100905\_053156-20100903\_063510.png

MODULE\_STEPPING ANALYSIS completed

#####

CALIBRATION PULSES ANALYSIS

#####

Creating directory ./RESULTS/DAILY/\_100905/CALIBRATION\_PULSES...

\*\*\*\*\*  
\*\*\*\*\*

ALL ROWS Analysis will be performed from 2010-09-05 00:00:00 to 2010-09-05 23:59:59

Analysing products WVS IS2 V/V

Writing image ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Calibration\_pulses\_all\_rows\_WVS\_IS2\_VV.png...

Analysing products GM1 SS3 H/H

Writing image ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Calibration\_pulses\_all\_rows\_GM1\_SS3\_HH.png...

\*\*\*\*\*  
\*\*\*\*\*

TEMPORAL EVOLUTION Analysis will be performed from 2010-09-05 00:00:00 to 2010-09-05 23:59:59

Analysing products WVS IS2 V/V

Getting calibration pulses data for WVS IS2 V/V from 2010-09-05 00:00:00 to 2010-09-05 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/\_100905/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2010-09-05\_1.dat...

Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_1.png...

Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2010-09-05 00:00:00 to 2010-09-05 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/\_100905/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2010-09-05\_2.dat...

Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_2.png...

Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2010-09-05 00:00:00 to 2010-09-05 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/\_100905/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2010-09-05\_3.dat...

Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_3.png...

Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2010-09-05 00:00:00 to 2010-09-05 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/\_100905/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2010-09-05\_4.dat...

Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_4.png...

Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_4.png...

Analysing products GM1 SS3 H/H

Getting calibration pulses data for GM1 SS3 H/H from 2010-09-05 00:00:00 to 2010-09-05 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/\_100905/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2010-09-05\_1.dat...

Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_1.png...

Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_1.png...





Getting calibration pulses data for GM1 SS3 H/H from 2010-09-05 00:00:00 to 2010-09-05 23:59:59. Rows: 2/6/10/14/18/22/26/30  
 Writing file ./RESULTS/DAILY/\_100905/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2010-09-05\_2.dat...  
 Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_2.png...  
 Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2010-09-05 00:00:00 to 2010-09-05 23:59:59. Rows: 3/7/11/15/19/23/27/31  
 Writing file ./RESULTS/DAILY/\_100905/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2010-09-05\_3.dat...  
 Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_3.png...  
 Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2010-09-05 00:00:00 to 2010-09-05 23:59:59. Rows: 4/8/12/16/20/24/28/32  
 Writing file ./RESULTS/DAILY/\_100905/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2010-09-05\_4.dat...  
 Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_4.png...  
 Writing ../../RESULTS/DAILY/\_100905//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_4.png...

CALIBRATION PULSES ANALYSIS completed  
 #####

DOPPLER ANALYSIS  
 #####  
 Creating directory ./RESULTS/DAILY/\_100905/DOPPLER...

\*\*\*\*\*  
 \*\*\*\*\*  
 DOPPLER ANX Analysis will be performed from 2010-09-05 00:00:00 to 2010-09-05 23:59:59

Analysing products WVS IS2 V/V  
 Getting doppler data for WVS IS2 V/V from 2010-09-05 00:00:00 to 2010-09-05 23:59:59...  
 Writing file ./RESULTS/DAILY/\_100905/DOPPLER/Doppler\_data\_WVS\_IS2\_VV\_2010-09-05.dat...  
 Running IDL program...  
 Writing file ../../RESULTS/DAILY/\_100905/DOPPLER/DOPPLER\_ANX\_WVS\_IS2\_VV.png...

Analysing products GM1 SS1 H/H  
 Getting doppler data for GM1 SS1 H/H from 2010-09-05 00:00:00 to 2010-09-05 23:59:59...  
 Writing file ./RESULTS/DAILY/\_100905/DOPPLER/Doppler\_data\_GM1\_SS1\_HH\_2010-09-05.dat...  
 Running IDL program...  
 Writing file ../../RESULTS/DAILY/\_100905/DOPPLER/DOPPLER\_ANX\_GM1\_SS1\_HH.png...

\*\*\*\*\*  
 \*\*\*\*\*  
 DOPPLER JUMPS Analysis will be performed on WSM products from 2010-09-05 00:00:00 to 2010-09-05 23:59:59

Analysing by default products WSM  
 Getting doppler jumps data for WSM from 2010-09-05 00:00:00 to 2010-09-05 23:59:59...  
 Writing file ./RESULTS/DAILY/\_100905/DOPPLER/Doppler\_Jumps\_data\_WSM\_2010-09-05.dat...  
 Running IDL program...  
 Writing file ../../RESULTS/DAILY/\_100905/DOPPLER/DOPPLER\_JUMPS\_ANX\_WSM.png...  
 Writing file ../../RESULTS/DAILY/\_100905/DOPPLER/DOPPLER\_JUMPS\_Date\_WSM.png...

\*\*\*\*\*  
 \*\*\*\*\*  
 DOPPLER MAP Analysis will be performed from 2010-09-05 00:00:00 to 2010-09-05 23:59:59

Analysing products WVS IS2 V/V  
 Loading predicted doppler values....  
 Phase: descending  
 Found data...  
 Computing mean error doppler estimated-predicted...

Mean error = -35.841854 Hz  
Writing file ../../RESULTS/DAILY/\_100905//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_WVS\_IS2\_VV\_desc.jpg...  
Writing file ../../RESULTS/DAILY/\_100905//DOPPLER/DOPPLER\_Absolute\_WVS\_IS2\_VV\_desc.jpg...

\*\*\*\*\*

Loading predicted doppler values....  
Phase: ascending  
Found data...  
Computing mean error doppler estimated-predicted...  
Mean error = -27.175082 Hz  
Writing file ../../RESULTS/DAILY/\_100905//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_WVS\_IS2\_VV\_asc.jpg...  
Writing file ../../RESULTS/DAILY/\_100905//DOPPLER/DOPPLER\_Absolute\_WVS\_IS2\_VV\_asc.jpg...

\*\*\*\*\*

Analysing products GM1 SS1 H/H  
Loading predicted doppler values....  
Phase: descending  
Found data...  
Computing mean error doppler estimated-predicted...  
Mean error = -3.7192226 Hz  
Writing file ../../RESULTS/DAILY/\_100905//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_GM1\_SS1\_HH\_desc.jpg...  
Writing file ../../RESULTS/DAILY/\_100905//DOPPLER/DOPPLER\_Absolute\_GM1\_SS1\_HH\_desc.jpg...

\*\*\*\*\*

Loading predicted doppler values....  
Phase: ascending  
Found data...  
Computing mean error doppler estimated-predicted...  
Mean error = -12.197604 Hz  
Writing file ../../RESULTS/DAILY/\_100905//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_GM1\_SS1\_HH\_asc.jpg...  
Writing file ../../RESULTS/DAILY/\_100905//DOPPLER/DOPPLER\_Absolute\_GM1\_SS1\_HH\_asc.jpg...

\*\*\*\*\*

DOPPLER ANALYSIS completed  
#####

CHIRP ANALYSIS  
#####  
Creating directory ./RESULTS/DAILY/\_100905/CHIRP...

\*\*\*\*\*

\*\*\*\*\*

CHIRP Analysis will be performed from 2010-09-05 00:00:00 to 2010-09-05 23:59:59

Analysing products WSM SS1 H/H  
\*\*\*\*\*  
Getting ScaleFactor data for WSM SS1 H/H from 2010-09-05 00:00:00 to 2010-09-05 23:59:59...  
Writing file ./RESULTS/DAILY/\_100905/CHIRP/ScaleFactor\_data\_WSM\_SS1\_HH\_2010-09-05.dat...  
Running IDL program...  
Writing file ../../RESULTS/DAILY/\_100905/CHIRP/ScaleFactor\_ANX\_WSM\_SS1\_HH.png...  
Writing file ../../RESULTS/DAILY/\_100905/CHIRP/ScaleFactor\_DATE\_WSM\_SS1\_HH.png...

Analysing products WSM SS1 V/V  
\*\*\*\*\*  
Getting ScaleFactor data for WSM SS1 V/V from 2010-09-05 00:00:00 to 2010-09-05 23:59:59...  
Writing file ./RESULTS/DAILY/\_100905/CHIRP/ScaleFactor\_data\_WSM\_SS1\_VV\_2010-09-05.dat...  
Running IDL program...  
Writing file ../../RESULTS/DAILY/\_100905/CHIRP/ScaleFactor\_ANX\_WSM\_SS1\_VV.png...



Writing file ../../RESULTS/DAILY/\_100905/CHIRP/ScaleFactor\_DATE\_WSM\_SS1\_VV.png...

CHIRP ANALYSIS completed

#####

RAW DATA ANALYSIS

#####

Analysis will be performed from 2010-09-05 00:00:00 to 2010-09-05 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_100905/RAW\_DATA

Creating directory ./RESULTS/DAILY/\_100905/RAW\_DATA...

\*\*\*\*\*

Getting raw data for WVS from 2010-09-05 00:00:00 to 2010-09-05 23:59:59...  
Writing file ./RESULTS/DAILY/\_100905/RAW\_DATA/Raw\_data\_WVS\_2010-09-05.dat...  
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/\_100905/RAW\_DATA/Raw\_data\_WVS\_input\_mean.png...  
Creating image ../../RESULTS/DAILY/\_100905/RAW\_DATA/Raw\_data\_WVS\_input\_stdev.png...  
Creating image ../../RESULTS/DAILY/\_100905/RAW\_DATA/Raw\_data\_WVS\_gain\_imbalance.png...

\*\*\*\*\*

Getting raw data for IMM from 2010-09-05 00:00:00 to 2010-09-05 23:59:59...  
Writing file ./RESULTS/DAILY/\_100905/RAW\_DATA/Raw\_data\_IMM\_2010-09-05.dat...  
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/\_100905/RAW\_DATA/Raw\_data\_IMM\_input\_mean.png...  
Creating image ../../RESULTS/DAILY/\_100905/RAW\_DATA/Raw\_data\_IMM\_input\_stdev.png...  
Creating image ../../RESULTS/DAILY/\_100905/RAW\_DATA/Raw\_data\_IMM\_gain\_imbalance.png...

RAW DATA ANALYSIS completed

#####

TELEMETRY ANALYSIS

#####

Analysis will be performed from 2010-09-05 00:00:00 to 2010-09-05 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_100905/TELEMETRY

Creating directory ./RESULTS/DAILY/\_100905/TELEMETRY...

Looking for gaps and missing lines in WVS products...

\*\*\*\*\*

Checking 25 products from PDE...  
Checking 23 products from PDK...

Looking for gaps and missing lines in GM1 products...

\*\*\*\*\*

Checking 42 products from PDE...  
Checking 46 products from PDK...

Looking for gaps and missing lines in APM products...

\*\*\*\*\*

No products from PDE...  
No products from PDK...

Looking for gaps and missing lines in IMM products...

\*\*\*\*\*

Checking 31 products from PDE...  
Checking 8 products from PDK...

Looking for gaps and missing lines in WSM products...

\*\*\*\*\*



Checking 30 products from PDE...  
Checking 23 products from PDK...  
Found product...ASA\_WSM\_1PNPDK20100905\_042823\_000002752092\_00377\_44519\_4751.N1 / 0 gaps / 30 missing lines  
Found product...ASA\_WSM\_1PNPDK20100905\_042823\_000002752092\_00377\_44519\_4749.N1 / 0 gaps / 30 missing lines

Creating graph of missing lines and gaps...  
\*\*\*\*\*  
Creating image: ./RESULTS/DAILY/\_100905/TELEMETRY/TELEMETRY\_Missing\_lines.png...  
Creating image: ./RESULTS/DAILY/\_100905/TELEMETRY/TELEMETRY\_Gaps.png...

TELEMETRY ANALYSIS completed  
#####

HTML REPORT generation  
#####

Building file ./RESULTS/DAILY/\_100905/asarReport.html...  
Building DATA SUMMARY section...  
Building AUXILIARY FILES ANALYSIS section...  
Building MODULE STEPPING ANALYSIS section...  
Building CALIBRATION PULSES ANALYSIS section...  
Building DOPPLER ANALYSIS section...  
Building CHIRP ANALYSIS section...  
Building RAW DATA ANALYSIS section...  
Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed  
#####





Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20100905_001402_000005312092_00374_44516_0182.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_002839_000002832092_00374_44516_0185.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_005803_000002772092_00374_44516_0204.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_012704_000010152092_00375_44517_0205.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_015030_000003562092_00375_44517_0207.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_020916_000006282092_00375_44517_0208.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_022542_000001502092_00375_44517_0211.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_023515_000003502092_00375_44517_0210.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_024235_000004532092_00375_44517_0212.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_025655_000004652092_00376_44518_0213.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_030527_000009432092_00376_44518_0226.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_032855_000000962092_00376_44518_0217.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_032855_000000962092_00376_44518_0224.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_035142_000004652092_00376_44518_0249.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_040604_000002652092_00376_44518_0248.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_043302_000011482092_00377_44519_0256.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_045546_000000842092_00377_44519_0255.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_050032_000005612092_00377_44519_0253.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_053029_000000782092_00377_44519_0279.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_053314_000004412092_00377_44519_0280.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_054551_000002172092_00377_44519_0282.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_061908_000003142092_00378_44520_0283.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_062701_000004712092_00378_44520_0297.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_063607_000003322092_00378_44520_0296.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_064449_000001872092_00378_44520_0295.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_064859_000004652092_00378_44520_0294.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_065743_000002952092_00378_44520_0293.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_195557_000001082092_00386_44528_0372.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_195955_000002172092_00386_44528_0374.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_203554_000002292092_00386_44528_0377.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_205249_000000662092_00386_44528_0378.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_205251_000001142092_00386_44528_0391.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_210042_000011842092_00386_44528_0394.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_213458_000002292092_00387_44529_0393.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_214124_000001442092_00387_44529_0396.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_221627_000001812092_00387_44529_0399.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_225212_000003562092_00388_44530_0414.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_231545_000006282092_00388_44530_0419.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_234207_000001442092_00388_44530_0418.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_234602_000002892092_00388_44530_0417.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_235057_000000842092_00388_44530_0421.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20100905_235701_000001502092_00388_44530_0424.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_071106_000002292092_00378_44520_4764.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_071859_000001022092_00378_44520_4766.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_072647_000001992092_00378_44520_4767.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_080723_000003022092_00379_44521_4769.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_081344_000000842092_00379_44521_4791.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_081918_000002172092_00379_44521_4792.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_083213_000006042092_00379_44521_4793.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_085140_000007432092_00379_44521_4794.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_090803_000001572092_00379_44521_4796.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_094340_000003082092_00380_44522_4797.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_095032_000001202092_00380_44522_4800.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_100654_000005252092_00380_44522_4821.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_103215_000001692092_00380_44522_4823.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_104128_000001812092_00380_44522_4822.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_104825_000001692092_00380_44522_4826.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_112451_000004282092_00381_44523_4828.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_121255_000001262092_00381_44523_4860.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_121754_000003202092_00381_44523_4863.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_122922_000001502092_00381_44523_4862.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_123804_000005192092_00381_44523_4866.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_125912_000009062092_00382_44524_4869.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_131337_000002472092_00382_44524_4887.N1					OK	OK	OK	OK



ASA_GM1_1PNPDK20100905_131915_000000722092_00382_44524_4888.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_133557_000006772092_00382_44524_4889.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_134720_000011482092_00382_44524_4890.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_140955_000001502092_00382_44524_4891.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_141823_000002652092_00382_44524_4896.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_142459_000003022092_00382_44524_4893.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_143425_000009852092_00383_44525_4899.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_143425_000009852092_00383_44525_4901.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_145221_000000722092_00383_44525_4921.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_150001_000004222092_00383_44525_4922.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_153404_000007012092_00383_44525_4924.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_155039_000001442092_00383_44525_4925.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_161410_000002892092_00384_44526_4926.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_162007_000003862092_00384_44526_4928.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_163546_000009552092_00384_44526_4952.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_171439_000002952092_00384_44526_4953.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_173140_000001142092_00384_44526_4955.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_175945_000003802092_00385_44527_4957.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_181556_000005432092_00385_44527_4980.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_185513_000002652092_00385_44527_4981.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_191146_000001502092_00385_44527_4982.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_192234_000001692092_00385_44527_4985.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_192857_000005012092_00385_44527_4986.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20100905_194248_000001632092_00386_44528_4988.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_IMM_1PNPDE20100905_003324_000004432092_00374_44516_0177.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_014824_000001132092_00375_44517_0200.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_021946_000000922092_00375_44517_0201.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_035927_000000922092_00376_44518_0239.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_045211_000002032092_00377_44519_0237.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_045713_000001892092_00377_44519_0238.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_054031_000001622092_00377_44519_0276.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_064755_000000512092_00378_44520_0275.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_071455_000002322092_00378_44520_0288.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_081225_000000682092_00379_44521_0318.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_103505_000003732092_00380_44522_0330.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_105449_000001422092_00380_44522_0341.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_121501_000001622092_00381_44523_0344.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_154543_000000922092_00383_44525_0355.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_161900_000000592092_00384_44526_0361.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_165140_000001392092_00384_44526_0364.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_171933_000003022092_00384_44526_0365.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_172523_000001942092_00384_44526_0362.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_175602_000000372092_00385_44527_0366.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_175702_000001552092_00385_44527_0367.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_182500_000002392092_00385_44527_0370.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_185938_000003022092_00385_44527_0371.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_190528_000001622092_00385_44527_0368.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_195749_000001142092_00386_44528_0387.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_201433_000000442092_00386_44528_0389.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_203944_000003022092_00386_44528_0388.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_204534_000002332092_00386_44528_0375.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_214535_000000392092_00387_44529_0409.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_221928_000002322092_00387_44529_0408.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_222408_000003032092_00387_44529_0390.N1					OK	OK	OK	OK
ASA_IMM_1PNPDE20100905_235930_000000912092_00388_44530_0432.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20100905_063448_000000632092_00378_44520_4752.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20100905_072045_000001622092_00378_44520_4778.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20100905_080050_000000922092_00379_44521_4780.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20100905_100115_000000972092_00380_44522_4809.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20100905_122311_000000922092_00381_44523_4861.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20100905_123718_000000372092_00381_44523_4877.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20100905_131742_000000822092_00382_44524_4880.N1					OK	OK	OK	OK
ASA_IMM_1PNPDK20100905_145047_000000832092_00383_44525_4897.N1					OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.


Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WSM_1PNPDE20100905_004158_000002812092_00374_44516_0189.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_011943_000004282092_00375_44517_0199.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_022230_000001842092_00375_44517_0202.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_023341_000000922092_00375_44517_0230.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_025135_000002202092_00376_44518_0234.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_032118_000004532092_00376_44518_0215.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_032118_000004532092_00376_44518_0222.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_040159_000002452092_00376_44518_0240.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_042854_000002452092_00377_44519_0241.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_054328_000001282092_00377_44519_0277.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_062426_000001472092_00378_44520_0278.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_064148_000001772092_00378_44520_0274.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_081520_000002322092_00379_44521_0319.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_082542_000003852092_00379_44521_0320.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_095243_000002392092_00380_44522_0327.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_095737_000002142092_00380_44522_0328.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_104434_000002262092_00380_44522_0340.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_111957_000002882092_00381_44523_0342.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_120028_000001222092_00381_44523_0343.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_132039_000000922092_00382_44524_0357.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_140635_000001842092_00382_44524_0358.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_145644_000001842092_00383_44525_0359.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_151038_000001592092_00383_44525_0360.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_154836_000001222092_00383_44525_0356.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_172925_000001282092_00384_44526_0363.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_190926_000001282092_00385_44527_0369.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_205027_000001282092_00386_44528_0386.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_213853_000001472092_00387_44529_0402.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_223018_000002452092_00387_44529_0407.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20100905_231300_000001592092_00388_44530_0431.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_025016_000003002092_00376_44518_4737.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_025016_000003002092_00376_44518_4750.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_042823_000002752092_00377_44519_4749.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_042823_000002752092_00377_44519_4751.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_072343_000001772092_00378_44520_4779.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_080343_000002142092_00379_44521_4781.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_090408_000002322092_00379_44521_4807.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_094853_000000922092_00380_44522_4810.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_095747_000000982092_00380_44522_4811.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_113208_000003062092_00381_44523_4837.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_113806_000001282092_00381_44523_4840.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_122534_000002262092_00381_44523_4868.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_125626_000000862092_00382_44524_4879.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_145345_000002812092_00383_44525_4908.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_150710_000005082092_00383_44525_4938.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_162637_000005442092_00384_44526_4937.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_180609_000005812092_00385_44527_4967.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_194539_000001772092_00386_44528_4995.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_194901_000000862092_00386_44528_4996.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_195105_000002882092_00386_44528_4999.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_212431_000002202092_00387_44529_5022.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_212941_000003062092_00387_44529_5024.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20100905_230757_000003552092_00388_44530_5030.N1					OK	OK	OK	OK







Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20100905_002256_000003002092_00374_44516_0183.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_004734_000003142092_00374_44516_0184.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_005204_000003142092_00374_44516_0203.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_010244_000009292092_00374_44516_0206.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_015627_000007192092_00375_44517_0209.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_022819_000002252092_00375_44517_0225.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_033039_000000742092_00376_44518_0216.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_033039_000000742092_00376_44518_0223.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_033139_000009292092_00376_44518_0247.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_041033_000010192092_00376_44518_0254.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_050956_000010042092_00377_44519_0252.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_052610_00000302092_00377_44519_0281.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_054931_000017392092_00377_44519_0292.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_070244_000002552092_00378_44520_0291.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_200334_000006142092_00386_44528_0373.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_201523_000011842092_00386_44528_0376.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_205454_000003002092_00386_44528_0392.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_214354_000000602092_00387_44529_0395.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_214620_000017692092_00387_44529_0397.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_223521_000002242092_00387_44529_0398.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_223806_000007942092_00387_44529_0413.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_230111_000003602092_00388_44530_0420.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_232618_000009142092_00388_44530_0416.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20100905_235228_000002252092_00388_44530_0422.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_070629_000002252092_00378_44520_4765.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_073007_000017992092_00378_44520_4768.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_084217_000005242092_00379_44521_4795.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_091043_000019342092_00379_44521_4799.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_101541_000009442092_00380_44522_4825.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_105119_000001802092_00380_44522_4824.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_105717_000013192092_00380_44522_4827.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_114024_000010792092_00381_44523_4859.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_120432_000004502092_00381_44523_4864.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_123155_000002552092_00381_44523_4865.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_124644_000005442092_00381_44523_4867.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_132213_000007792092_00382_44524_4895.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_141230_000003152092_00382_44524_4894.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_142252_000000892092_00382_44524_4892.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_143003_000001192092_00383_44525_4898.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_143003_000001192092_00383_44525_4900.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_151539_000010642092_00383_44525_4923.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_155306_000012142092_00383_44525_4927.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_165404_000011842092_00384_44526_4954.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_173342_000013042092_00384_44526_4956.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_182906_000015292092_00385_44527_4983.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_191418_000004502092_00385_44527_4984.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20100905_192525_000001642092_00385_44527_4987.N1					OK	OK	OK	OK

Calibration pulses for GM1 SS3 H/H




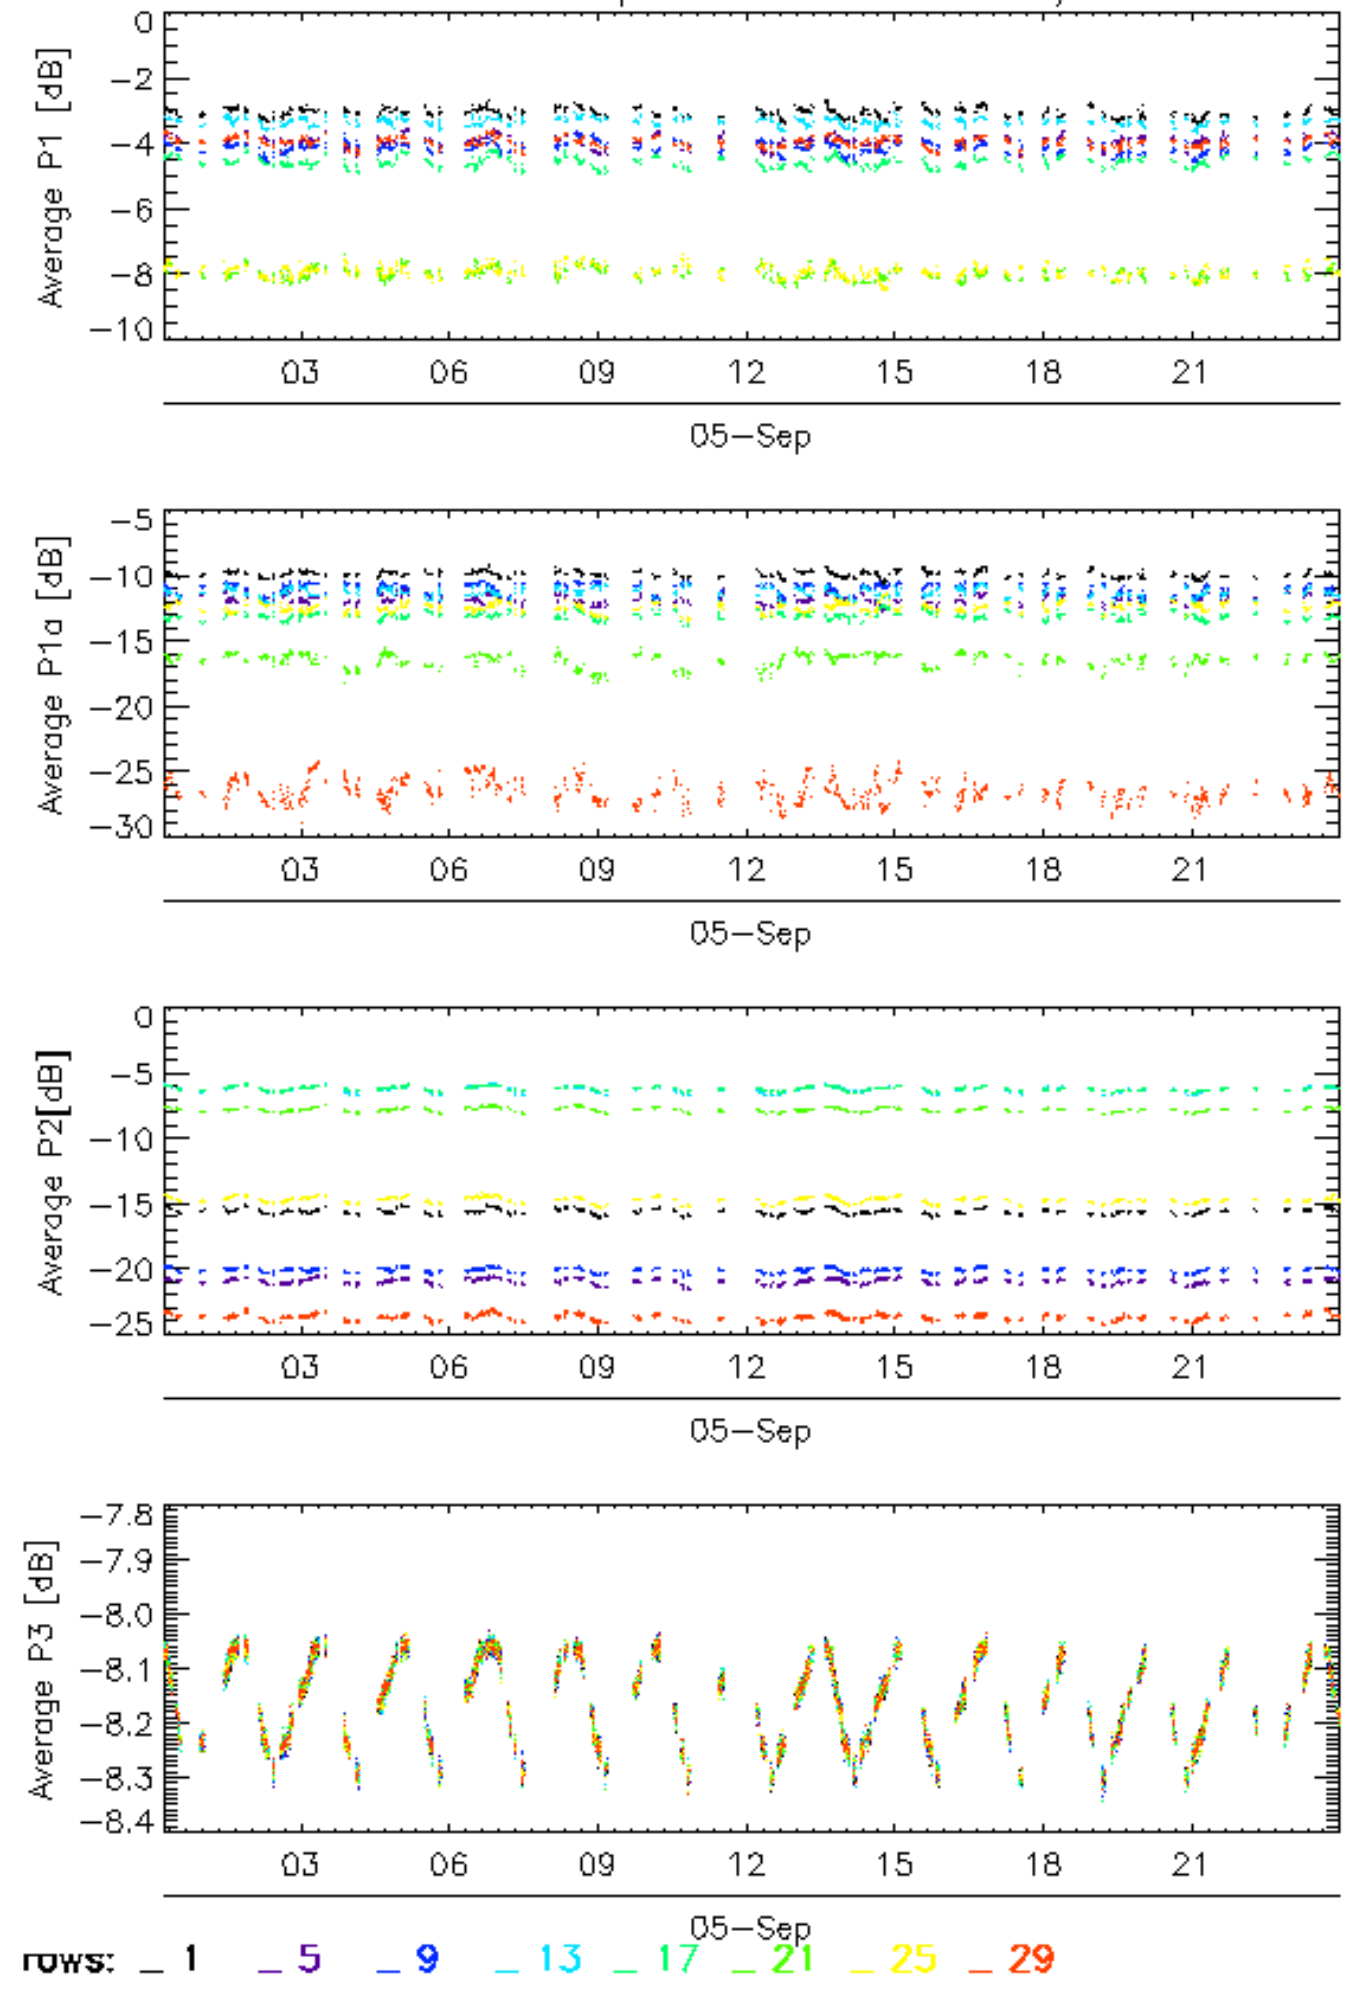


### Calibration pulses for GM1 SS3 H/H

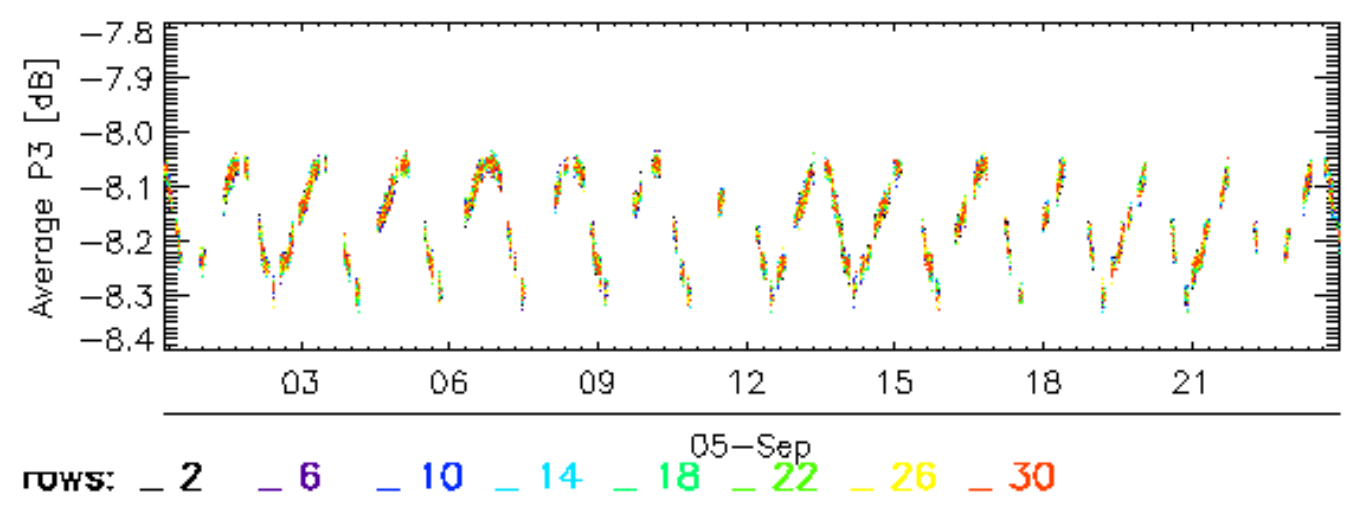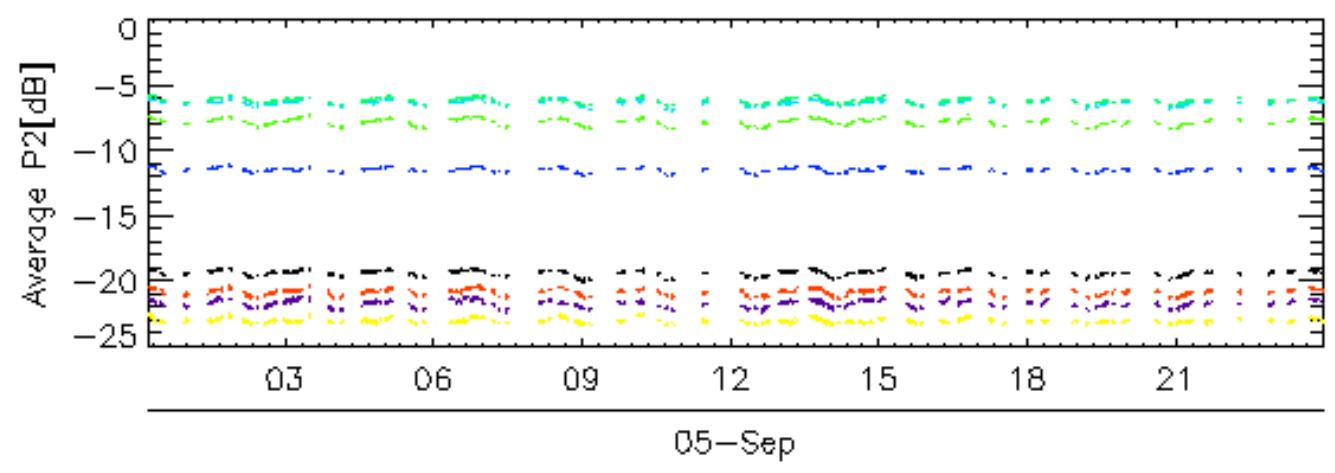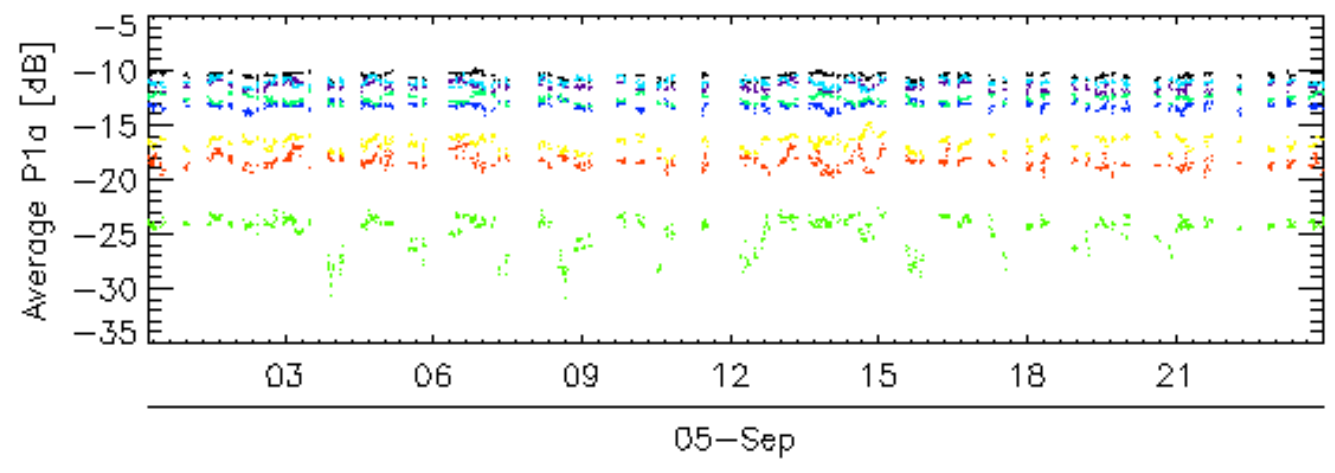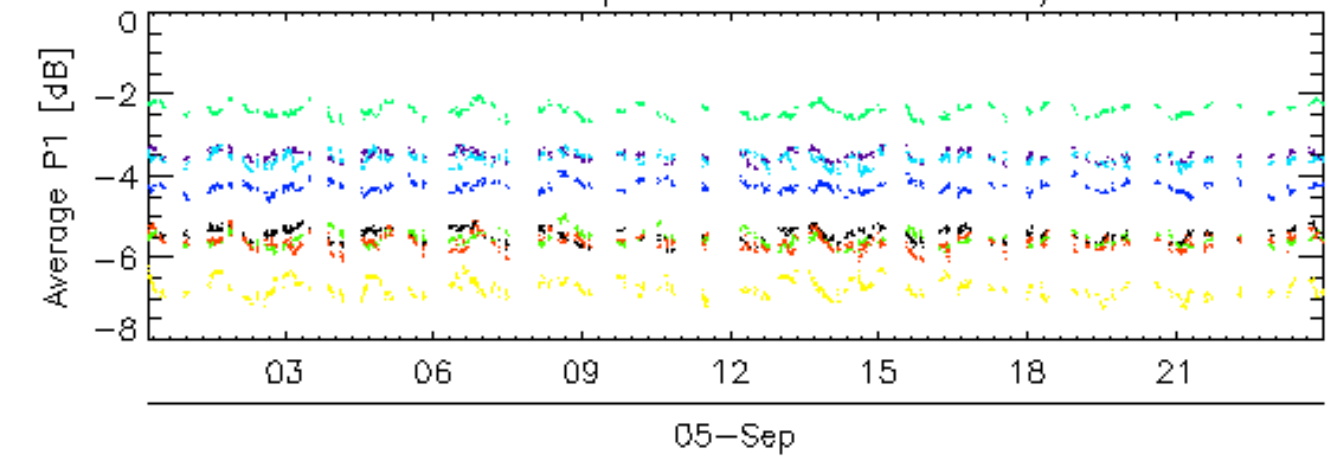







Calibration pulses for GM1 SS3 H/H

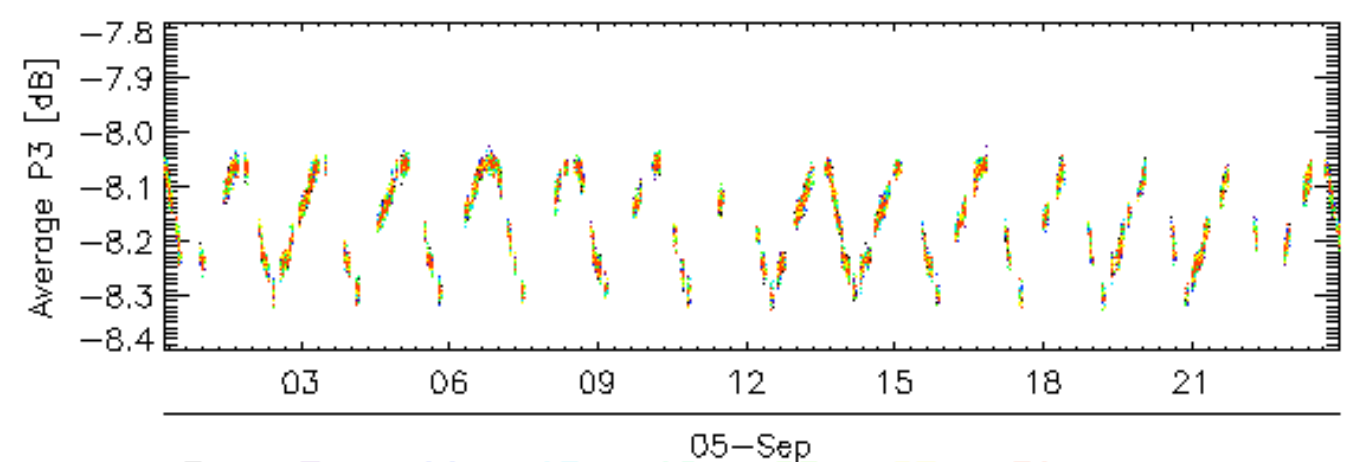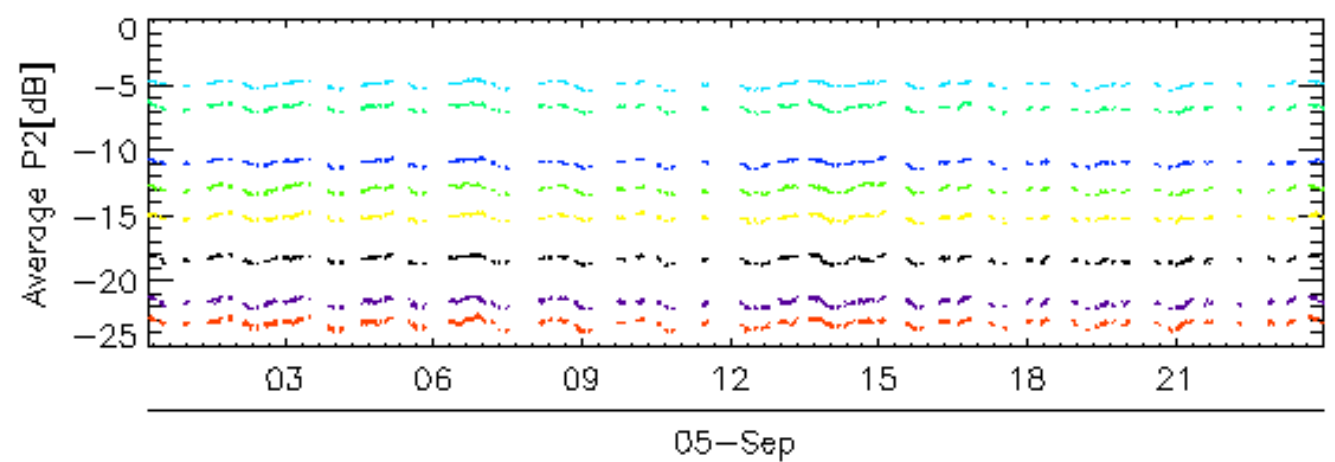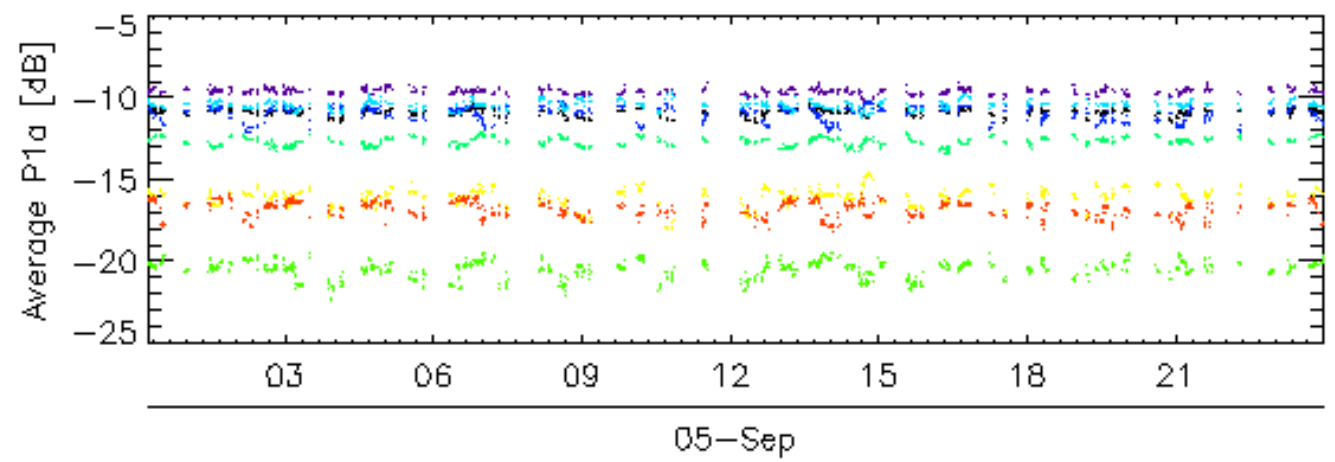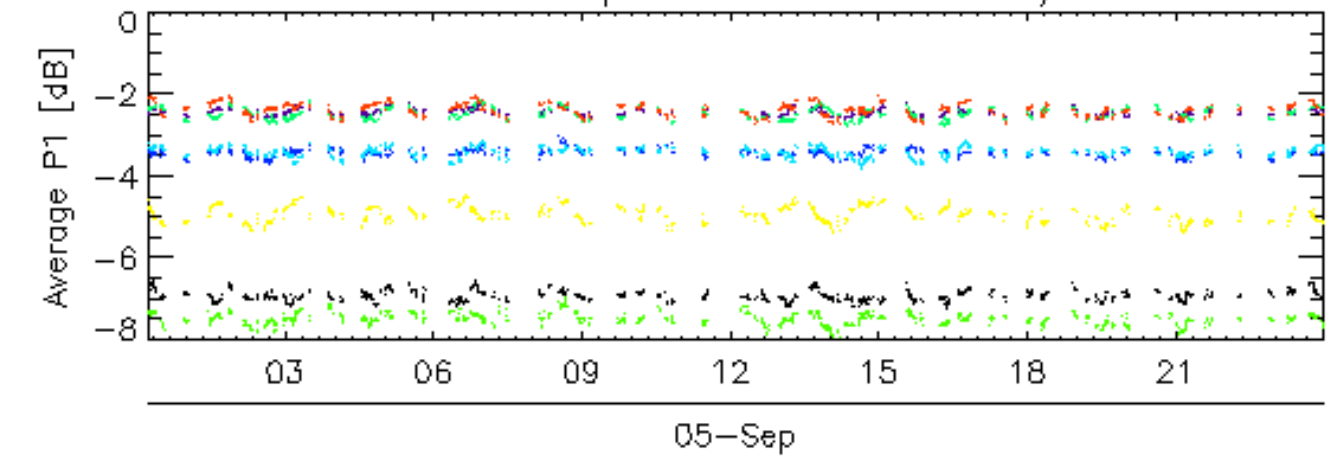


rows: **3** **7** **11** **15** **19** **23** **27** **31**

### Calibration pulses for GM1 SS3 H/H

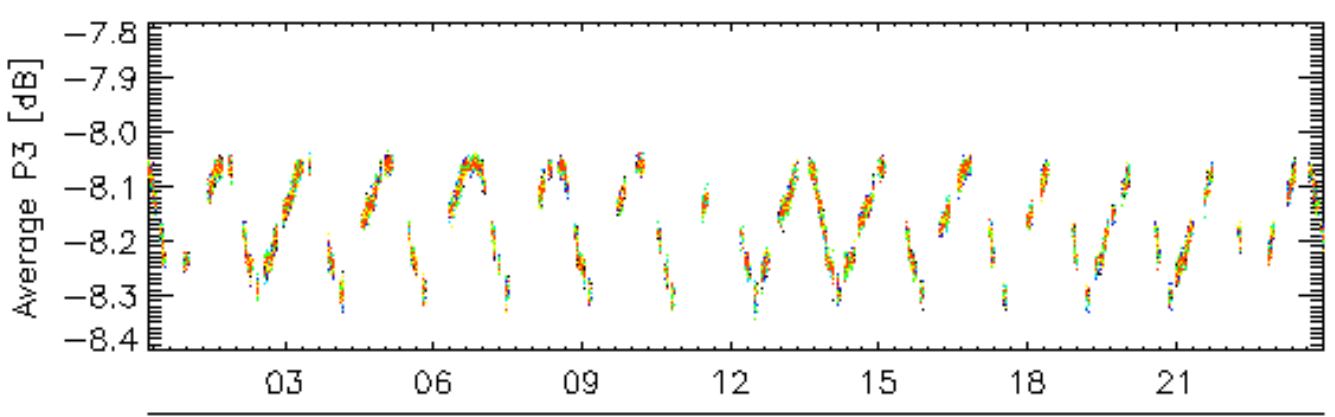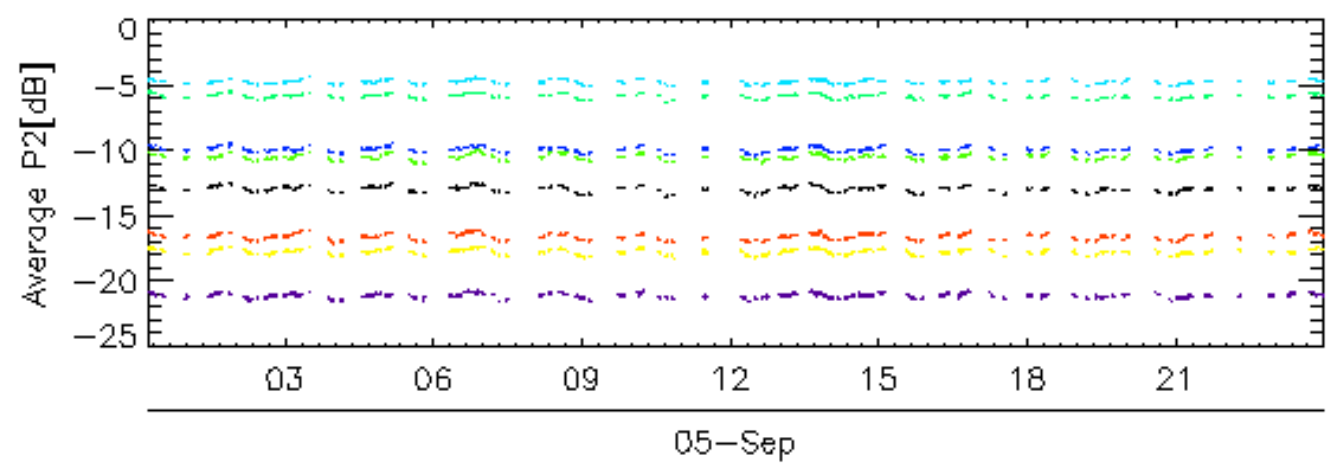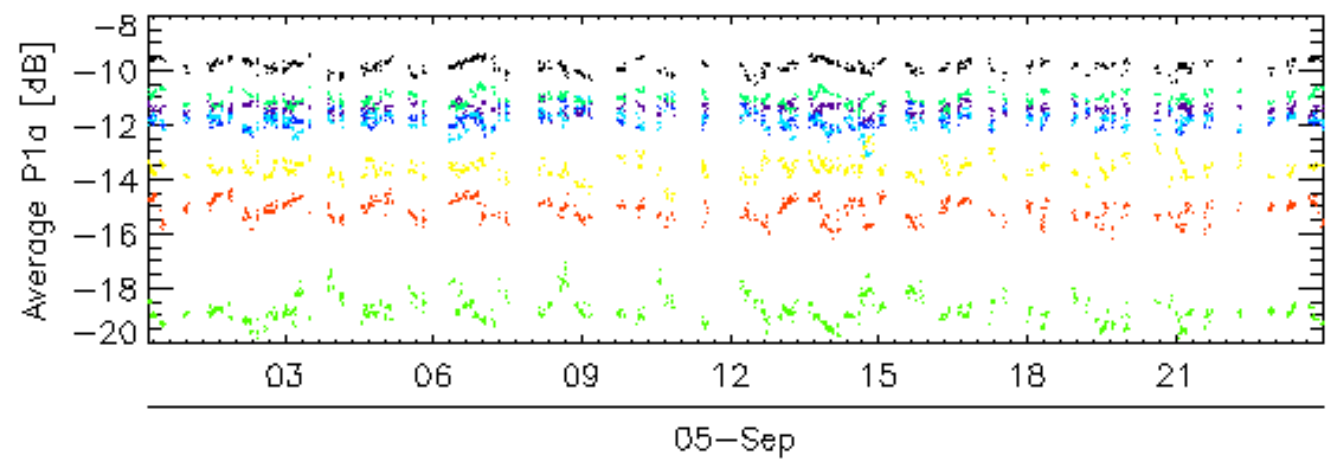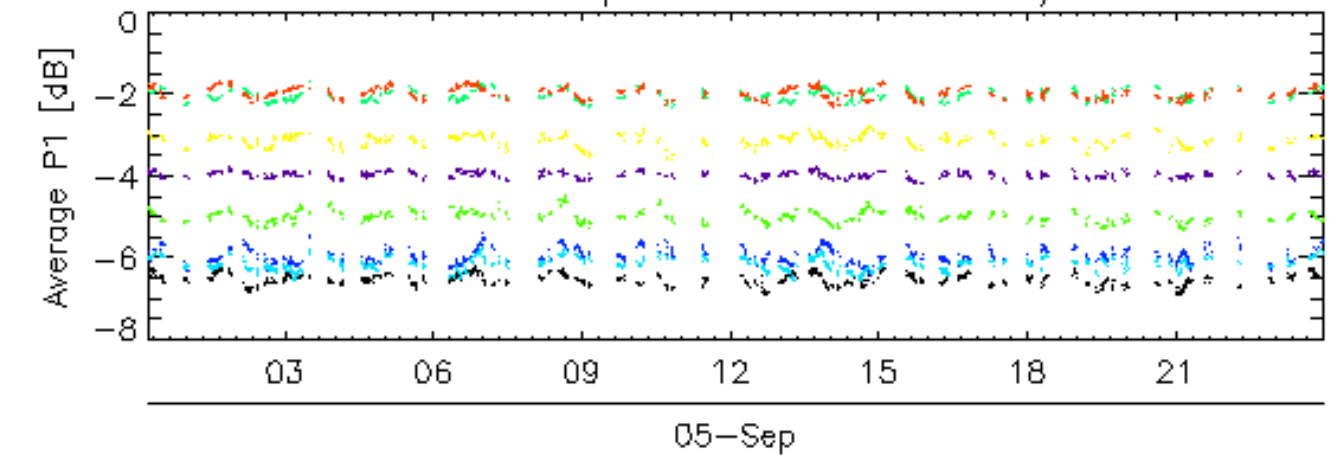


rows: 4 8 12 16 20 24 28 32

### Calibration pulses for WVS IS2 V/V

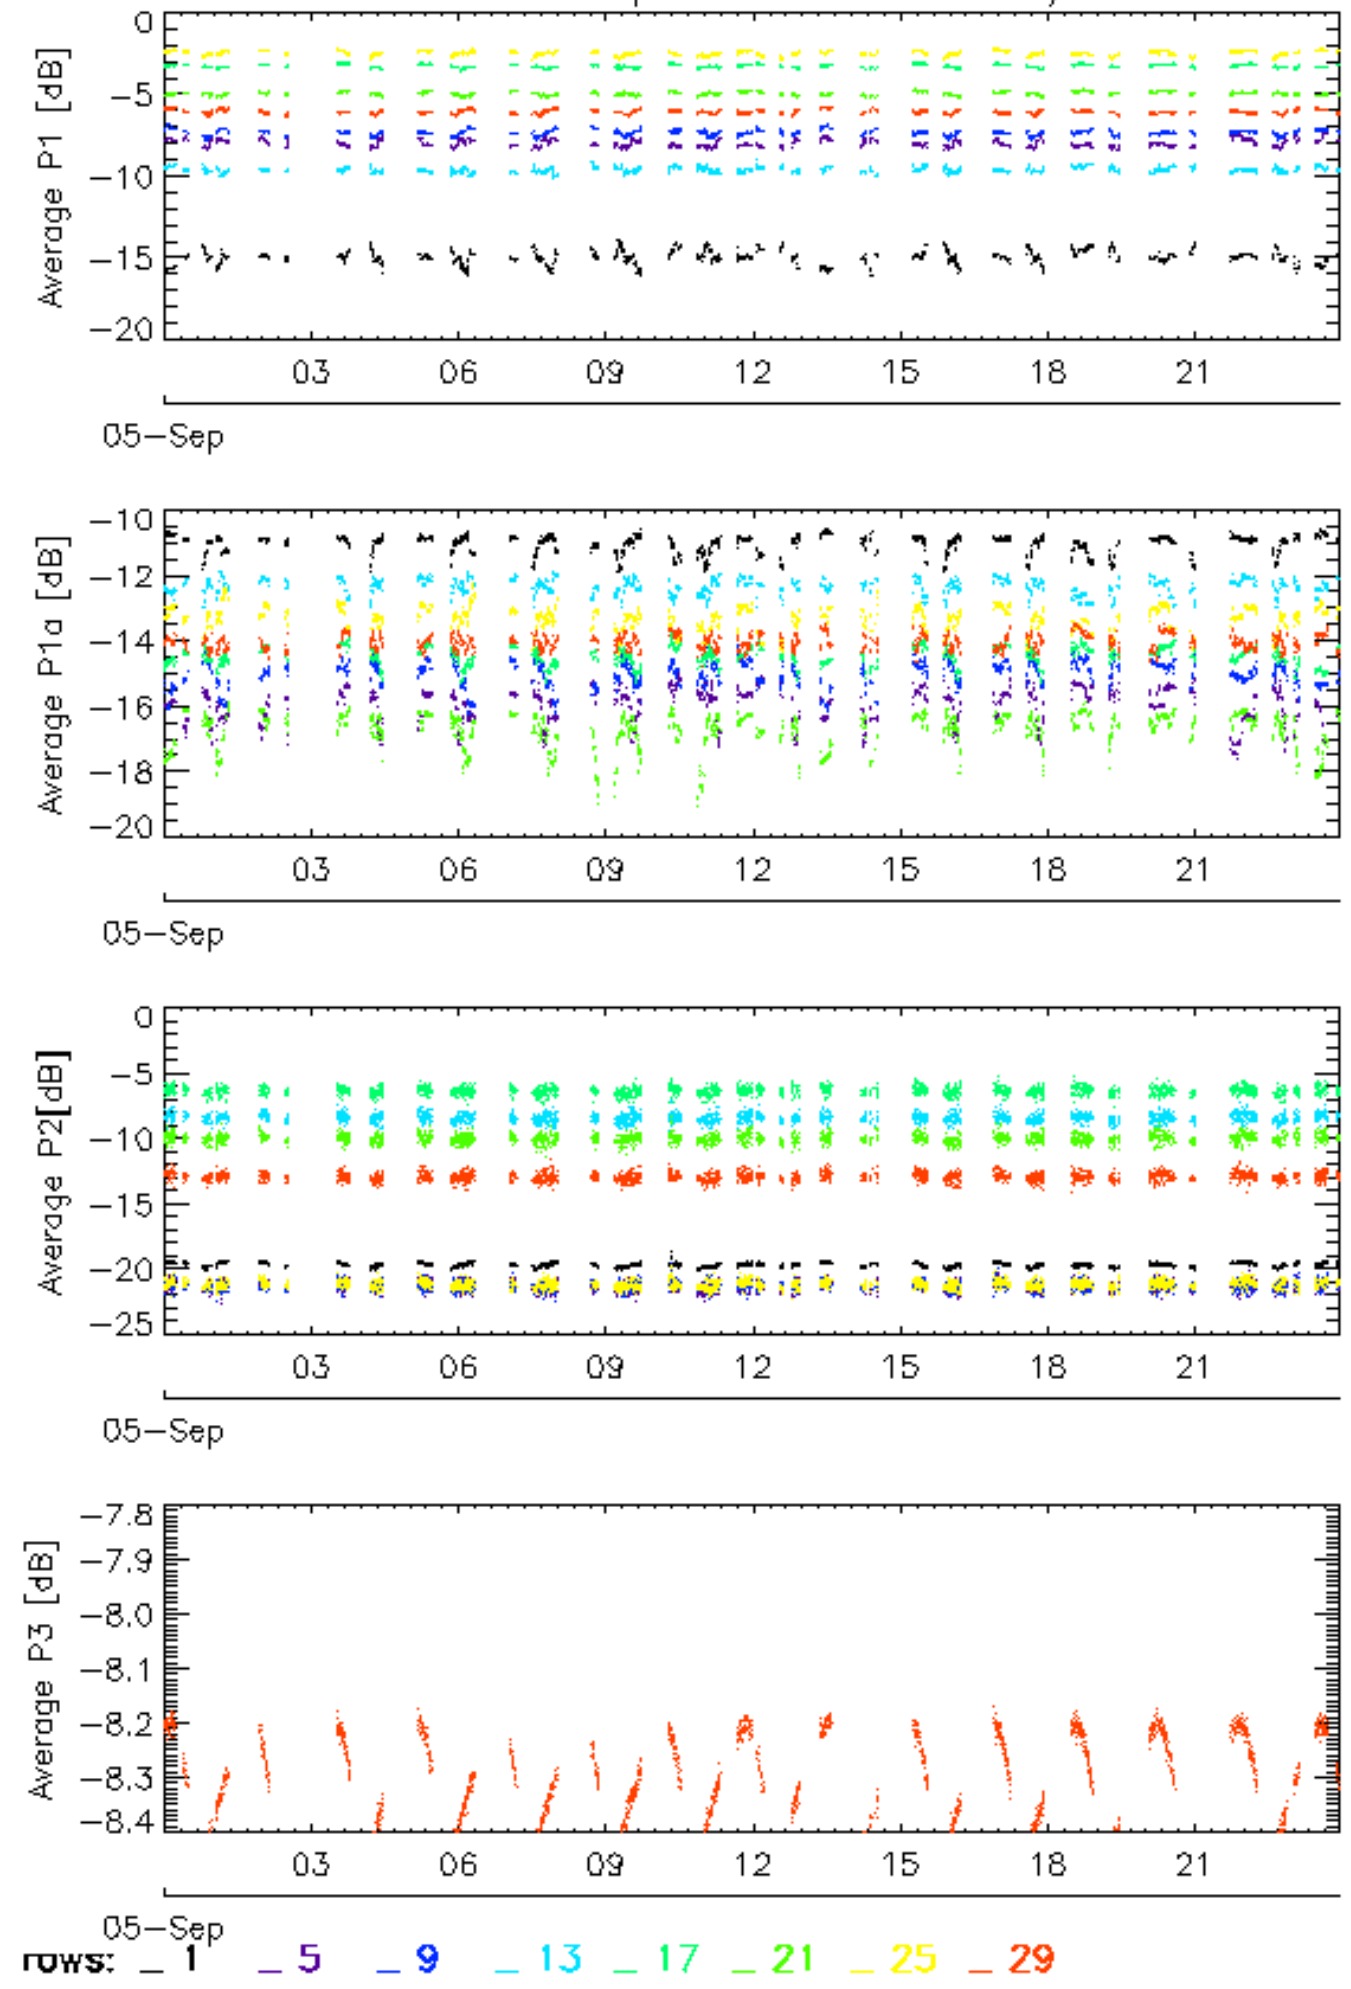





Calibration pulses for WVS IS2 V/V

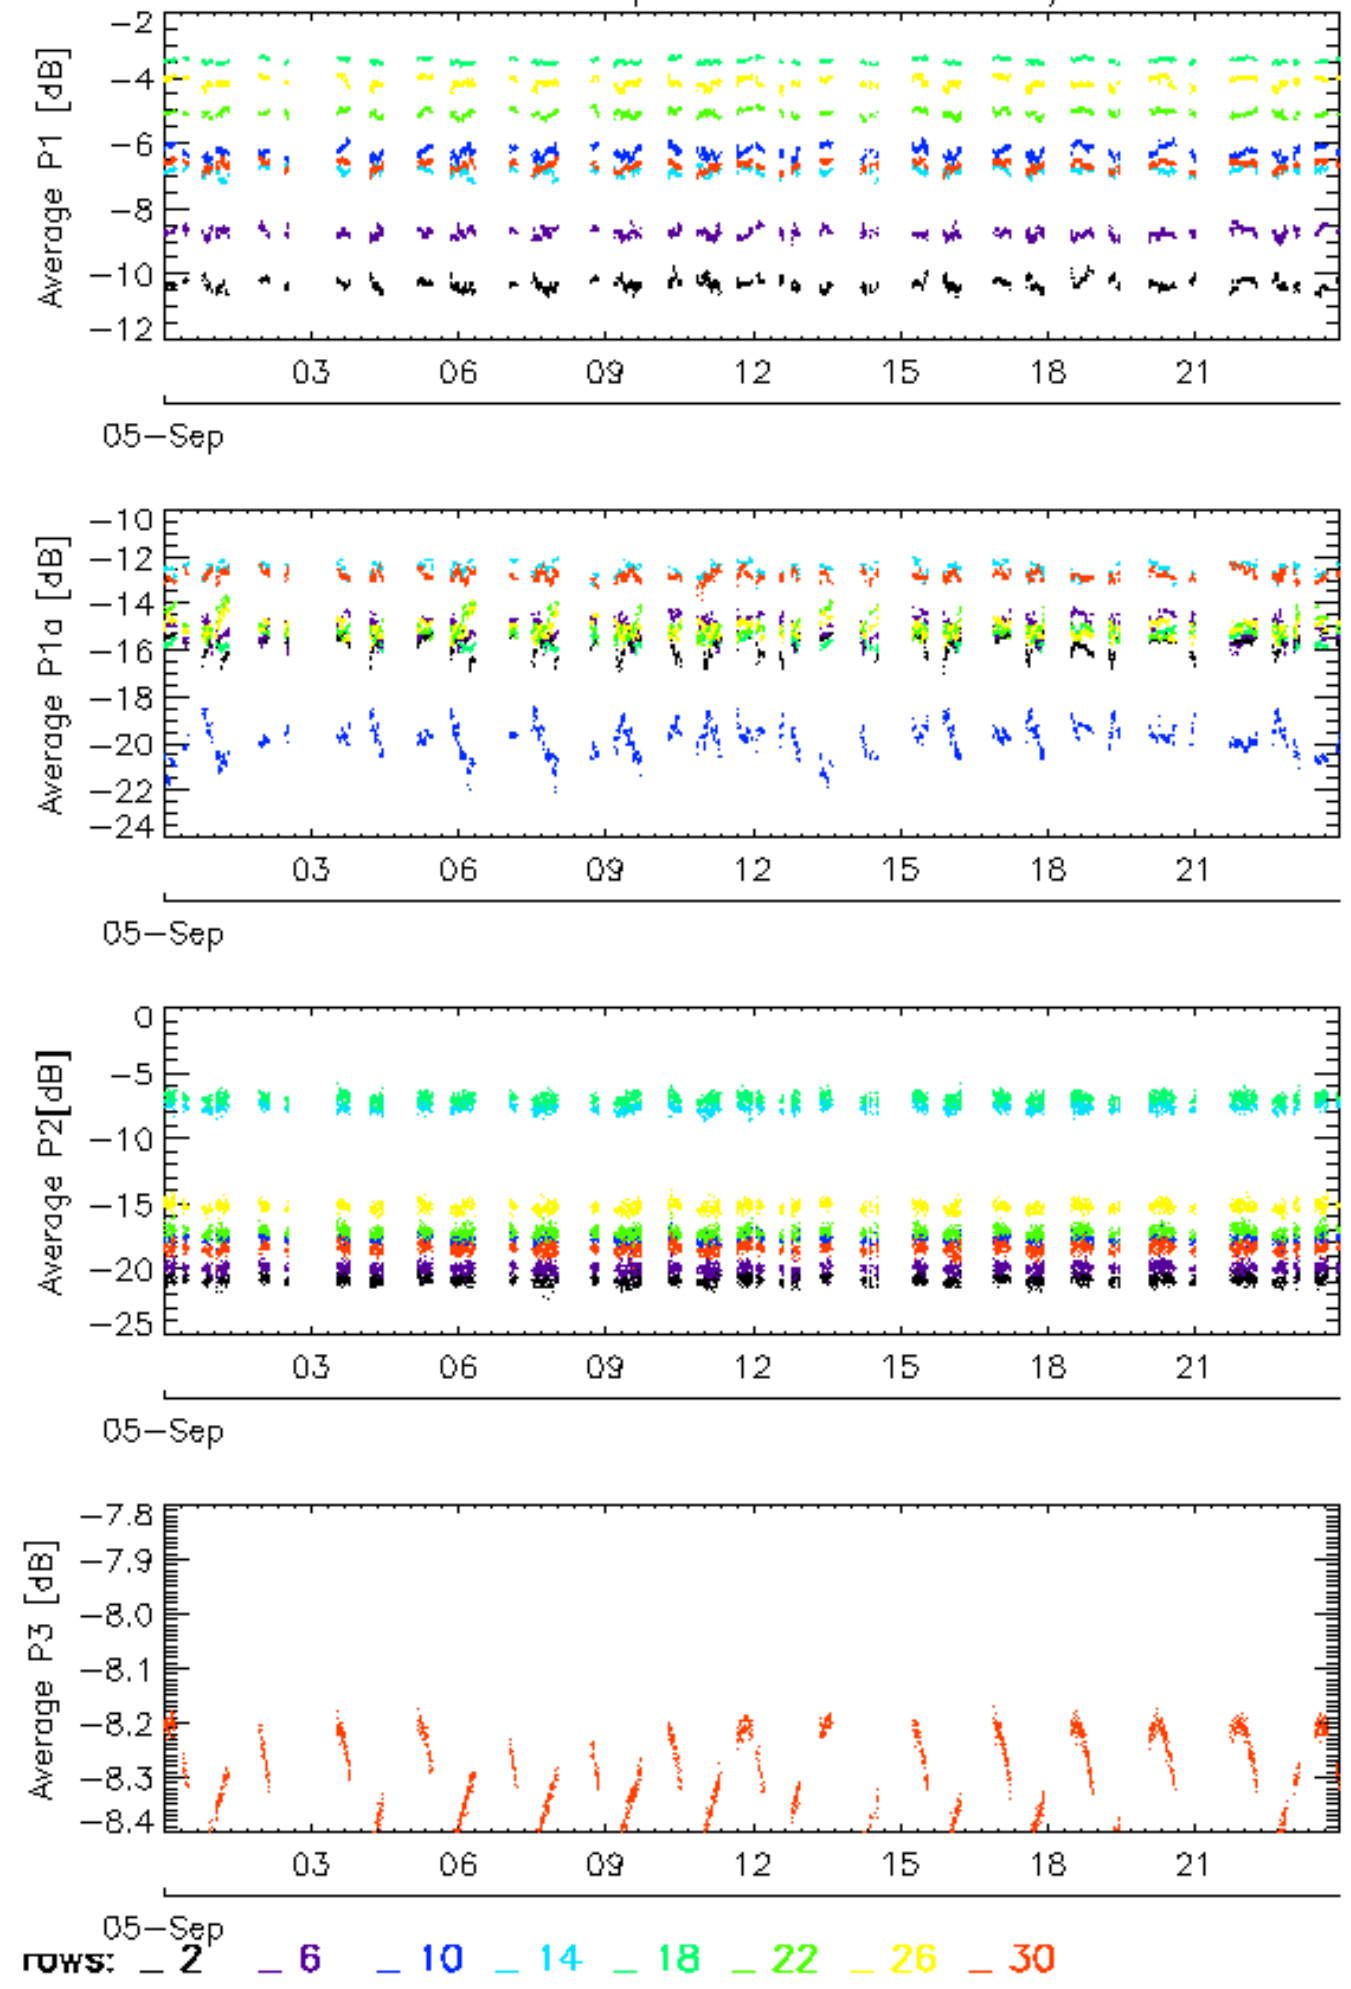


### Calibration pulses for WVS IS2 V/V

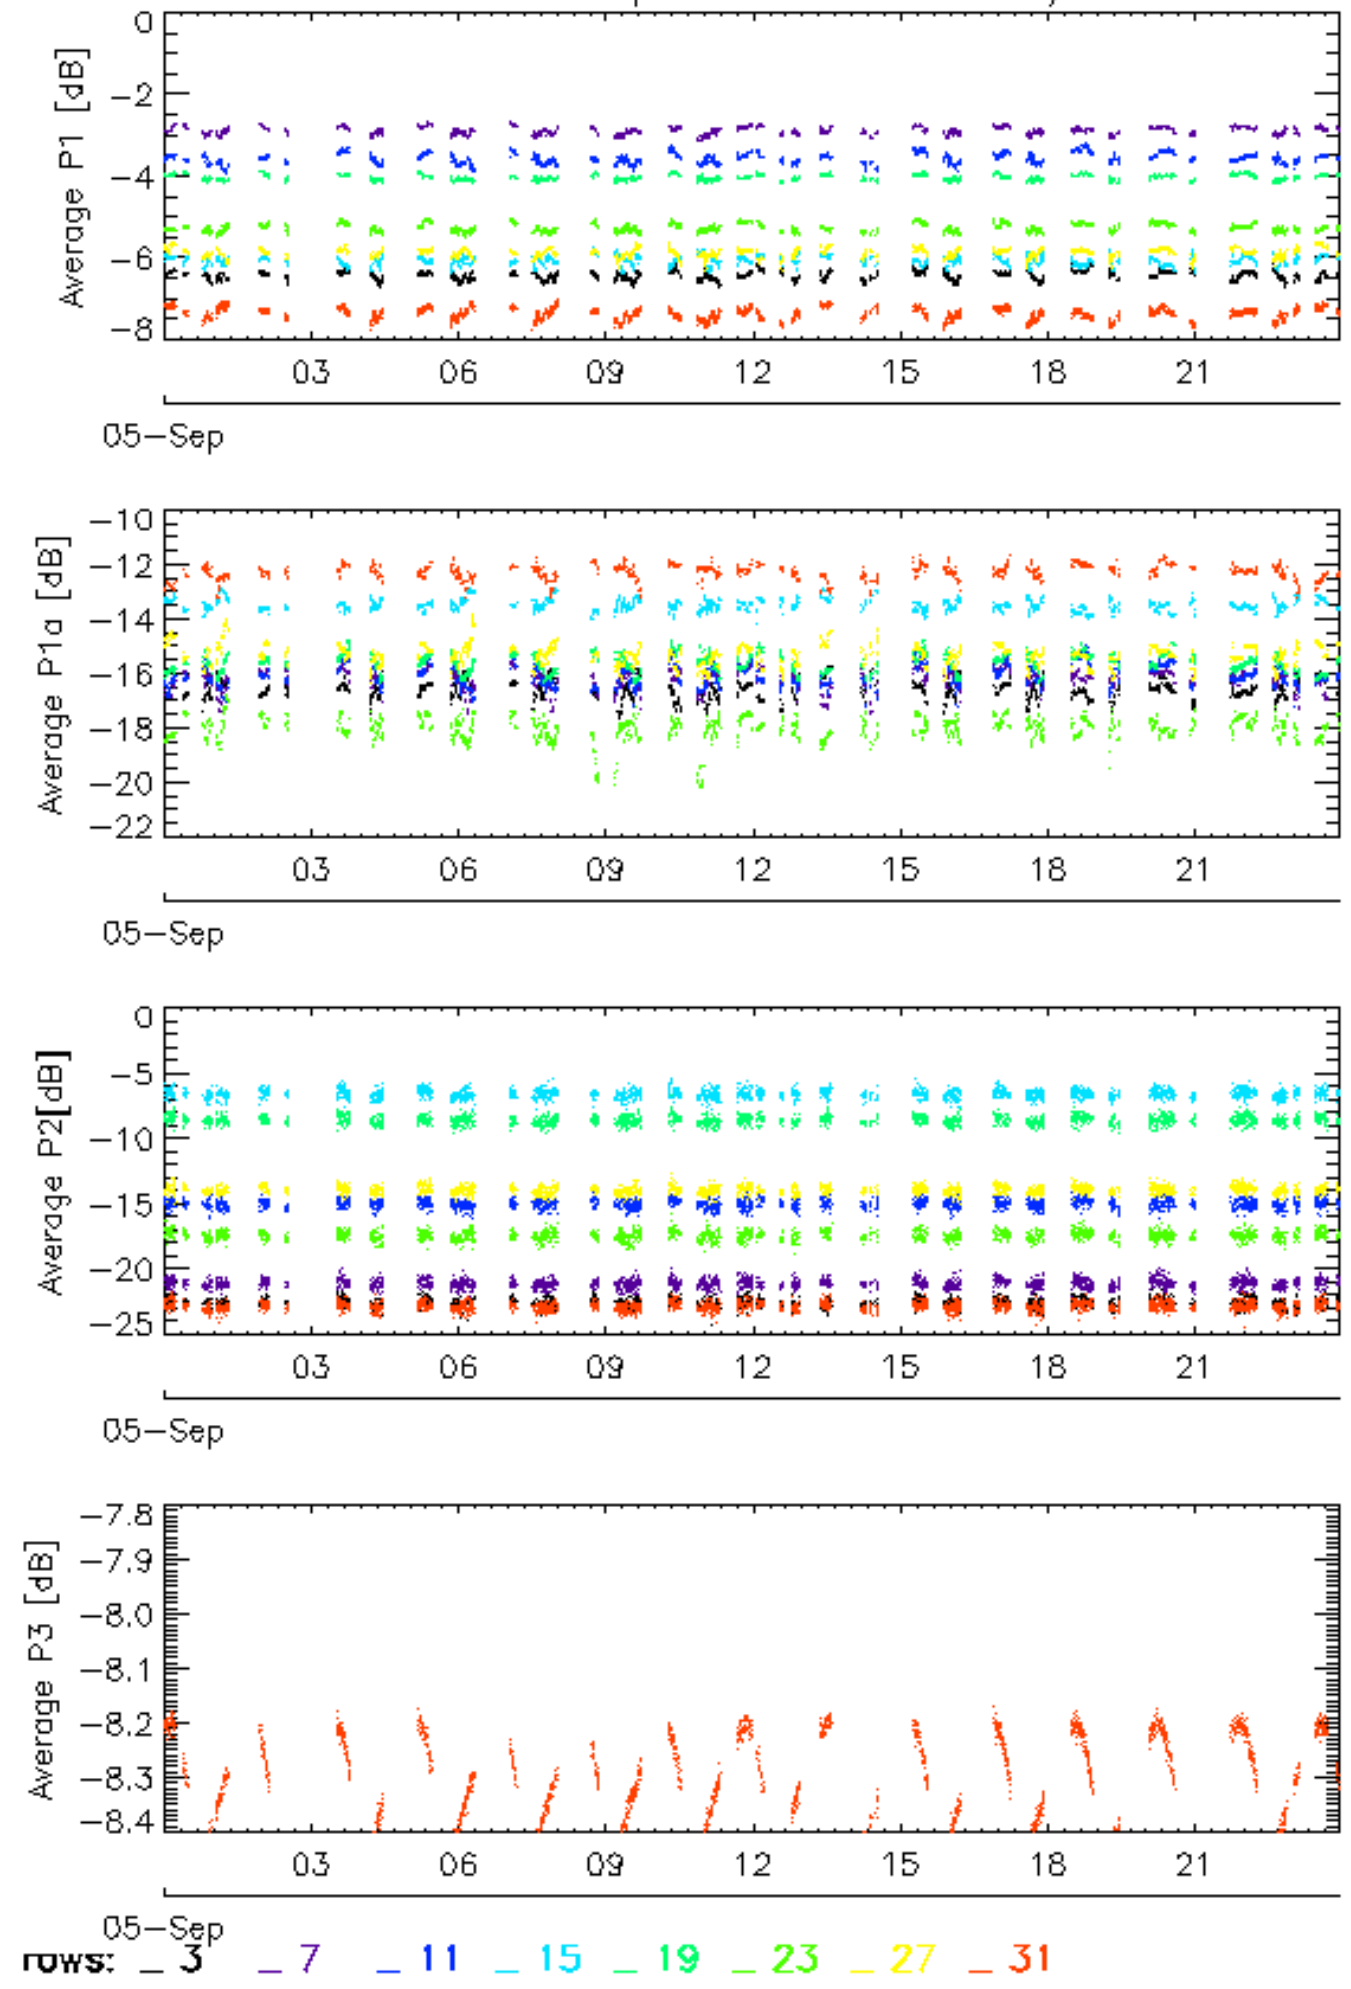




### Calibration pulses for WVS IS2 V/V

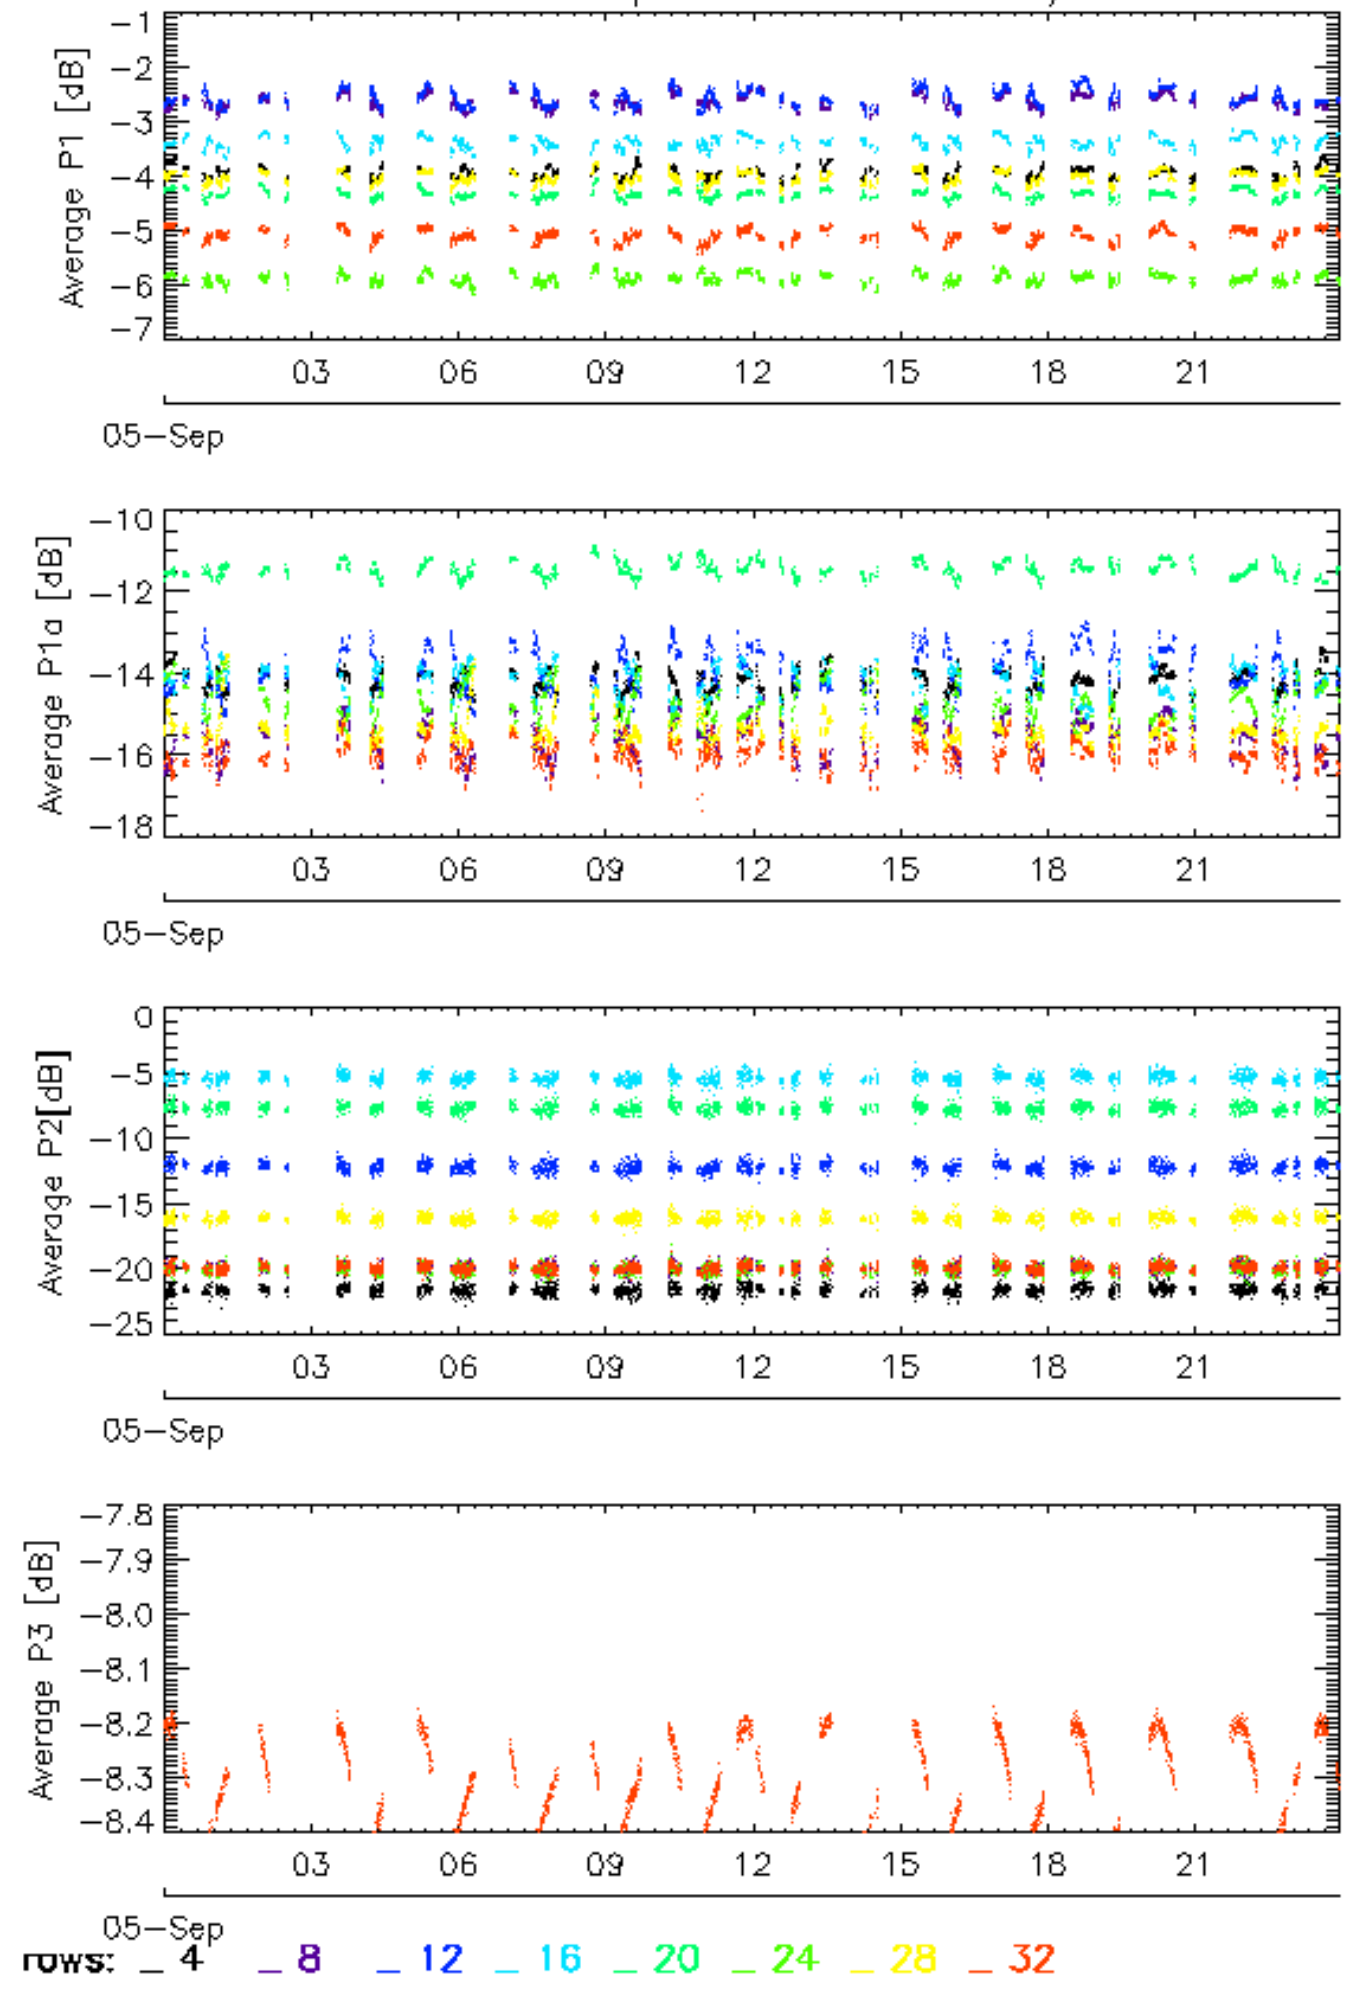




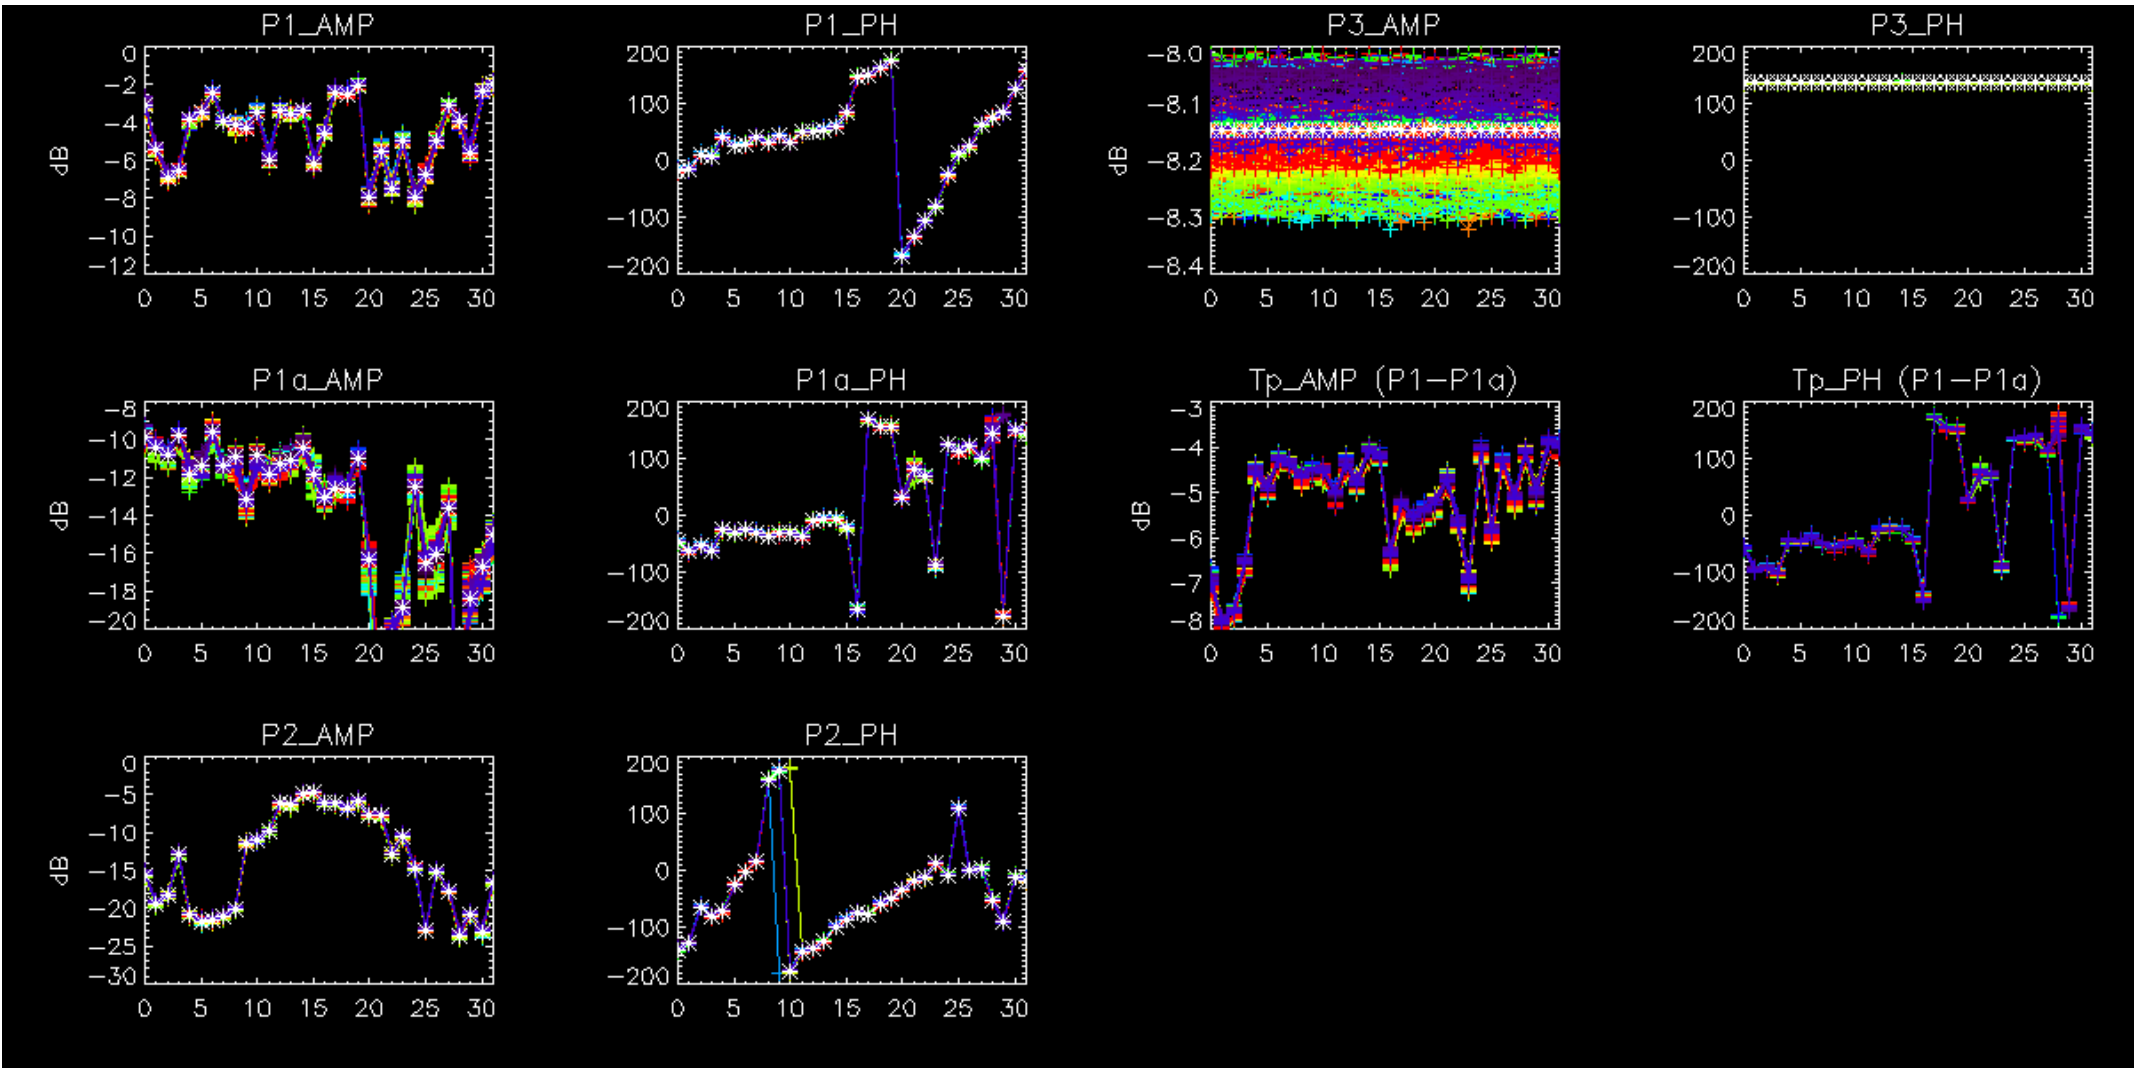



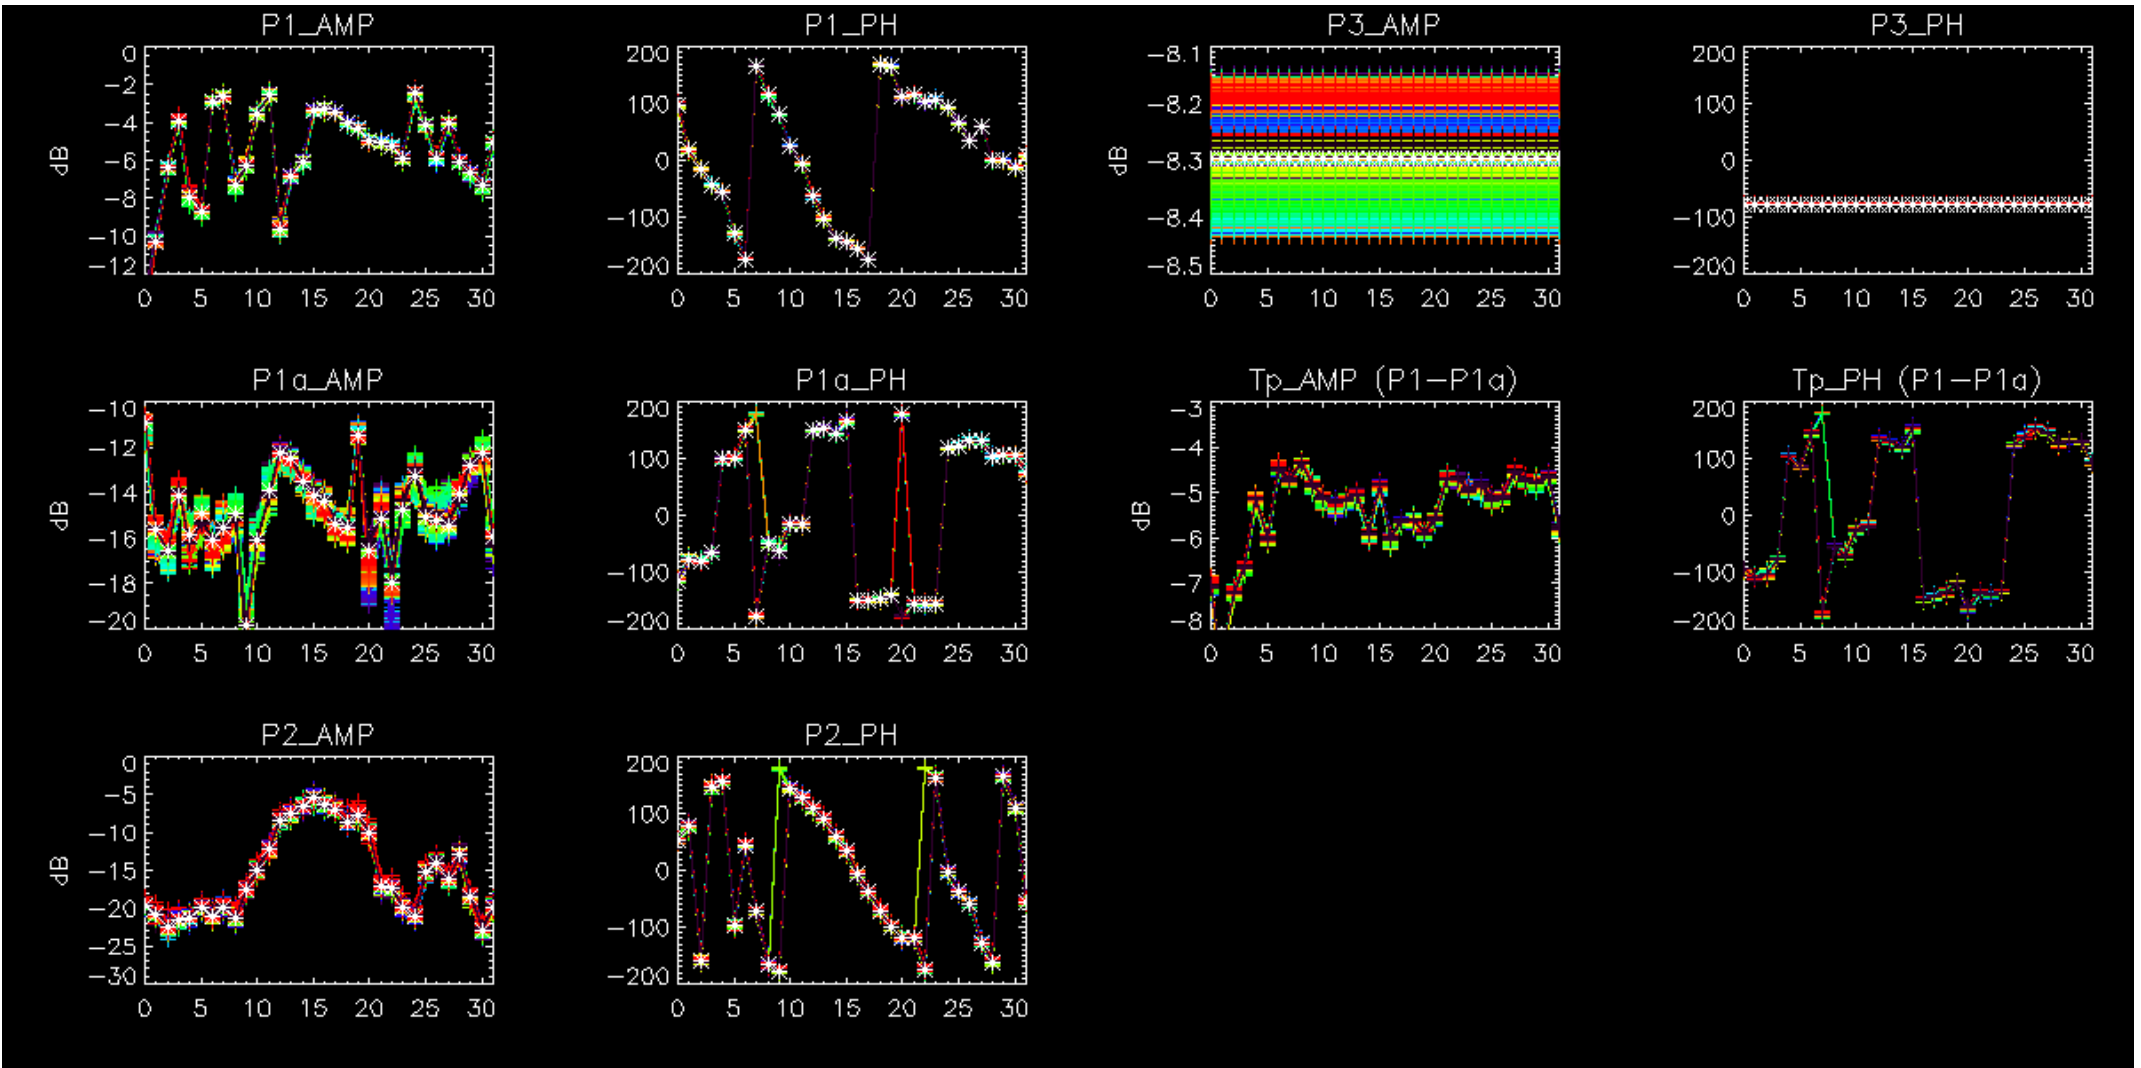


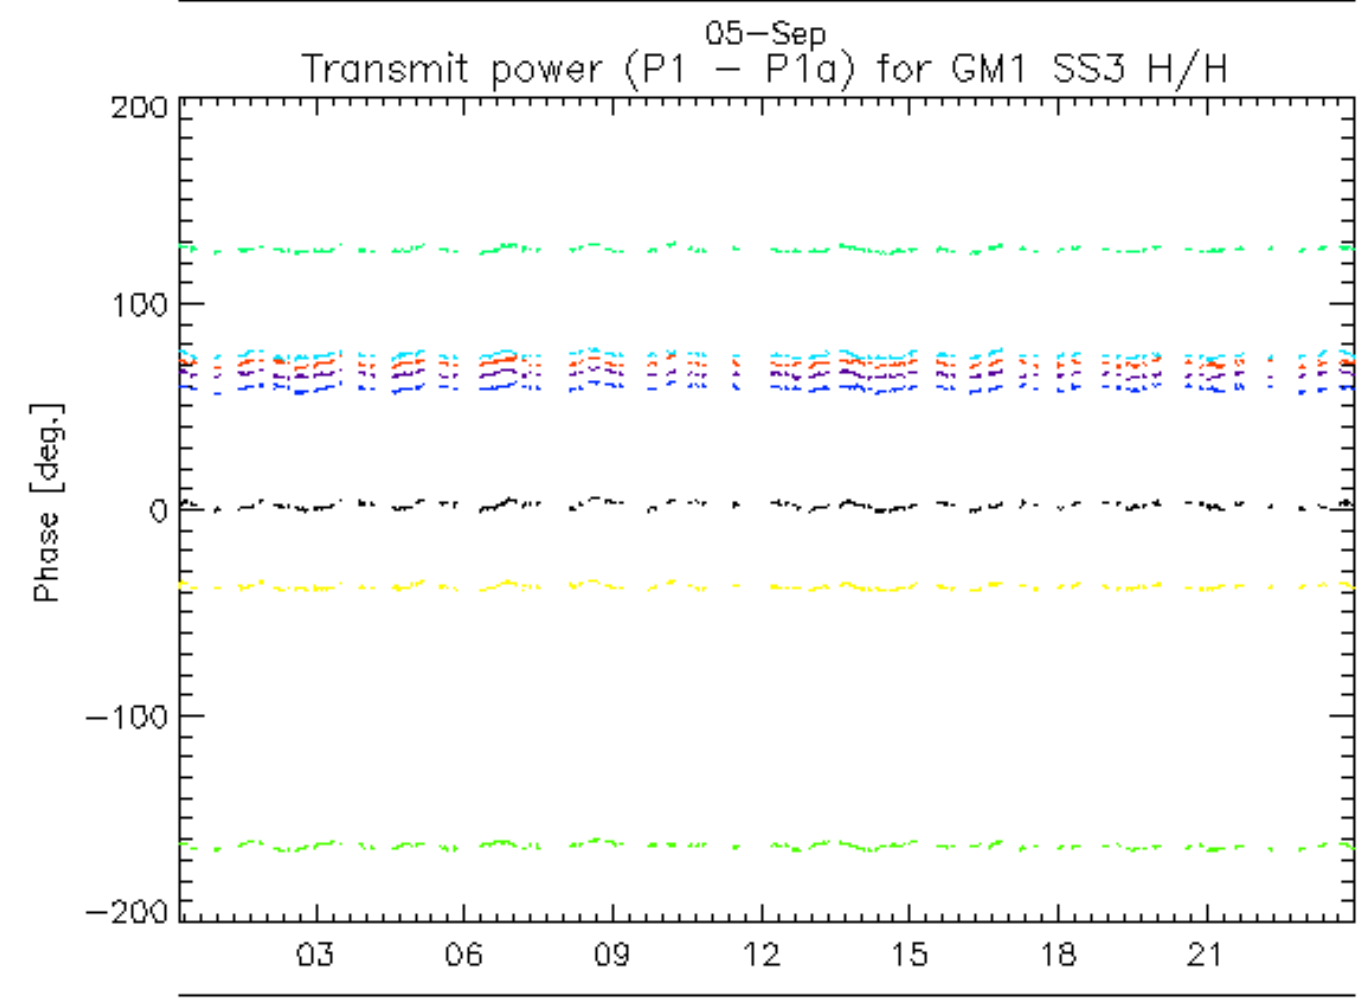
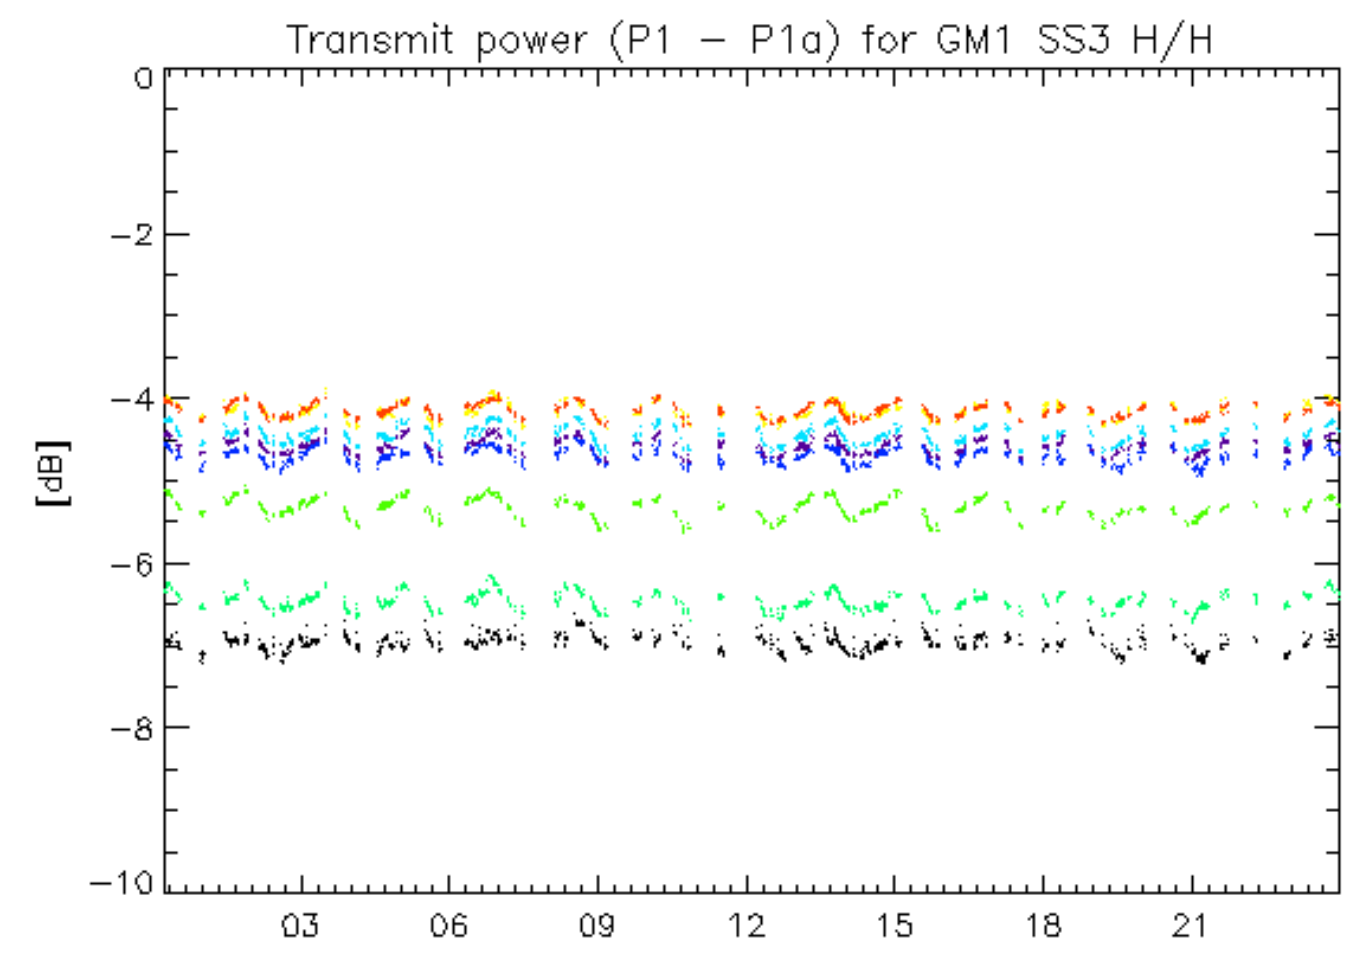


rows: \_ 1 \_ 5 \_ 9 \_ 13 \_ 17 \_ 21 \_ 25 \_ 29





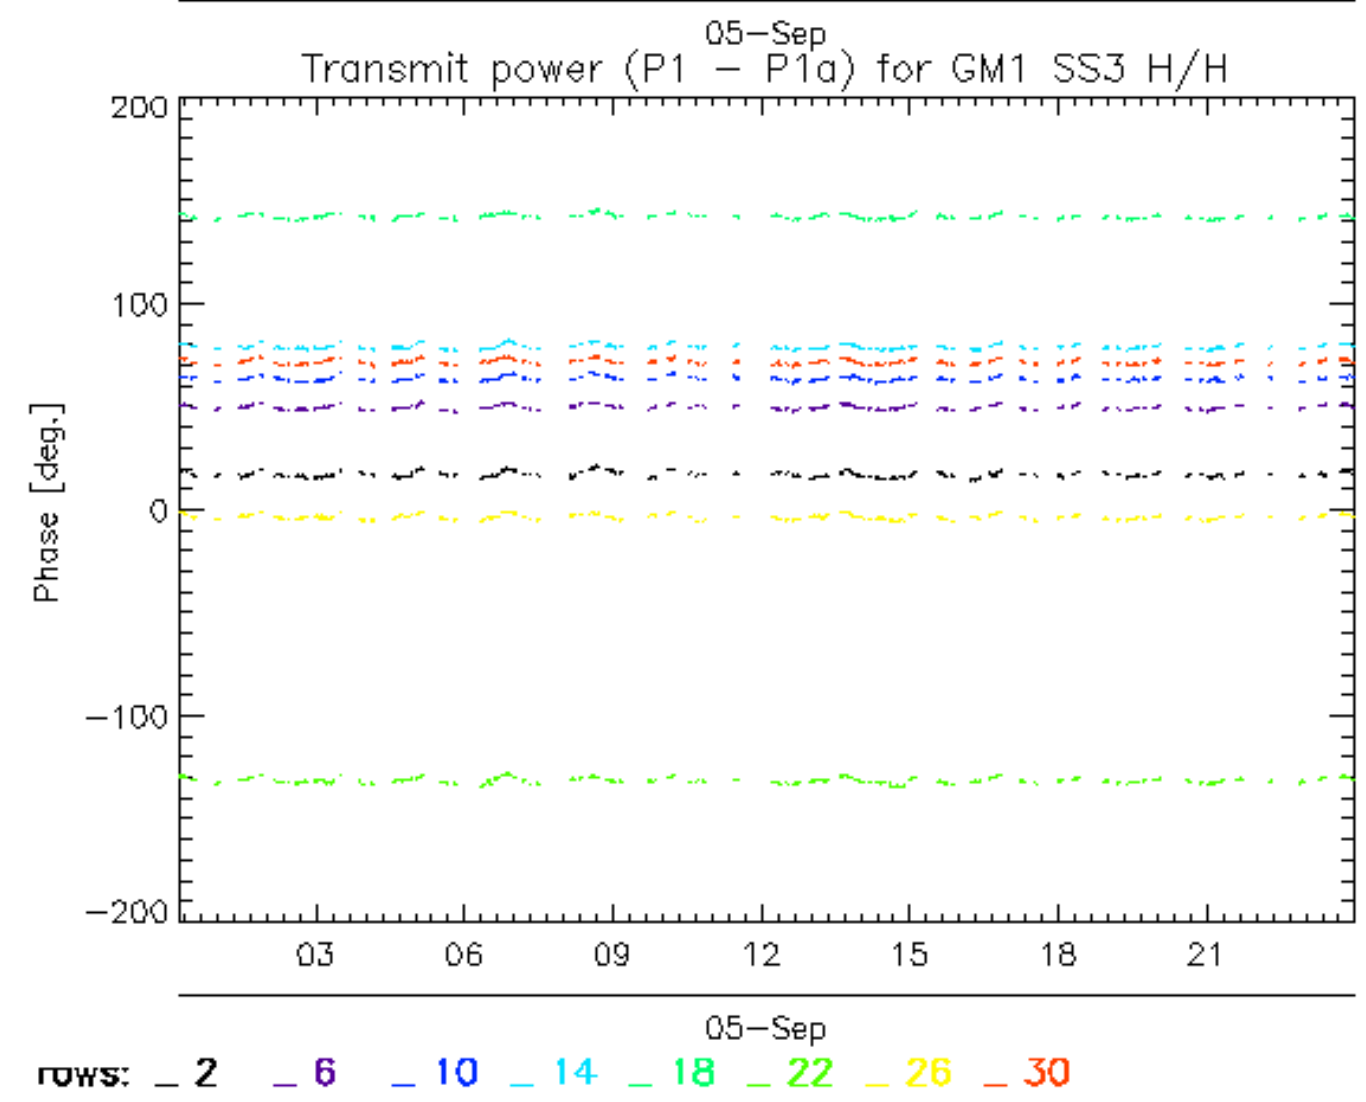
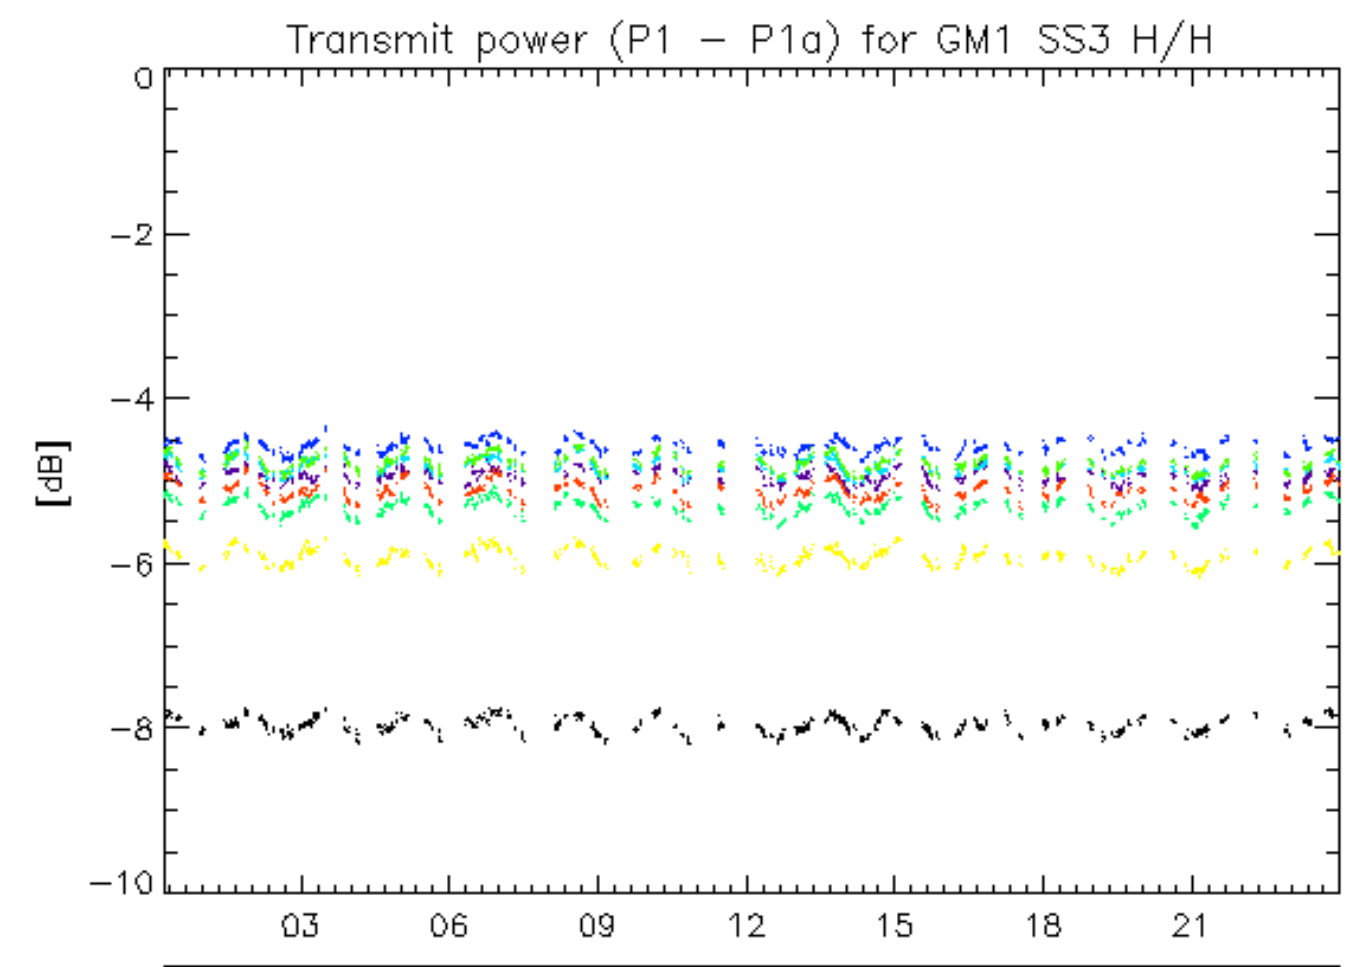


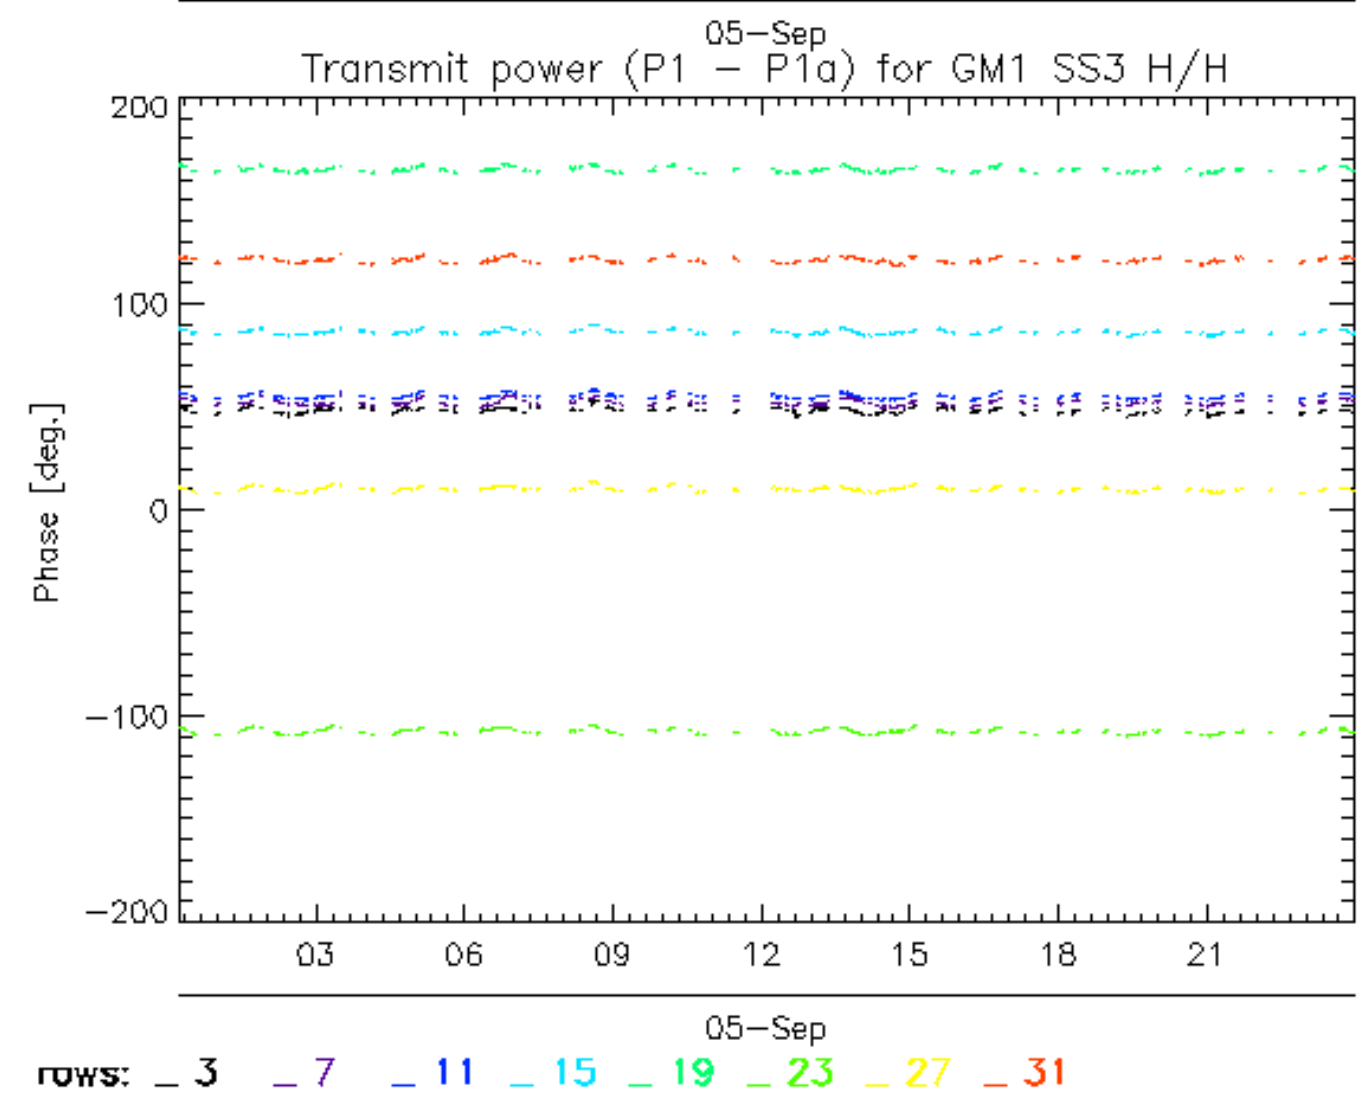
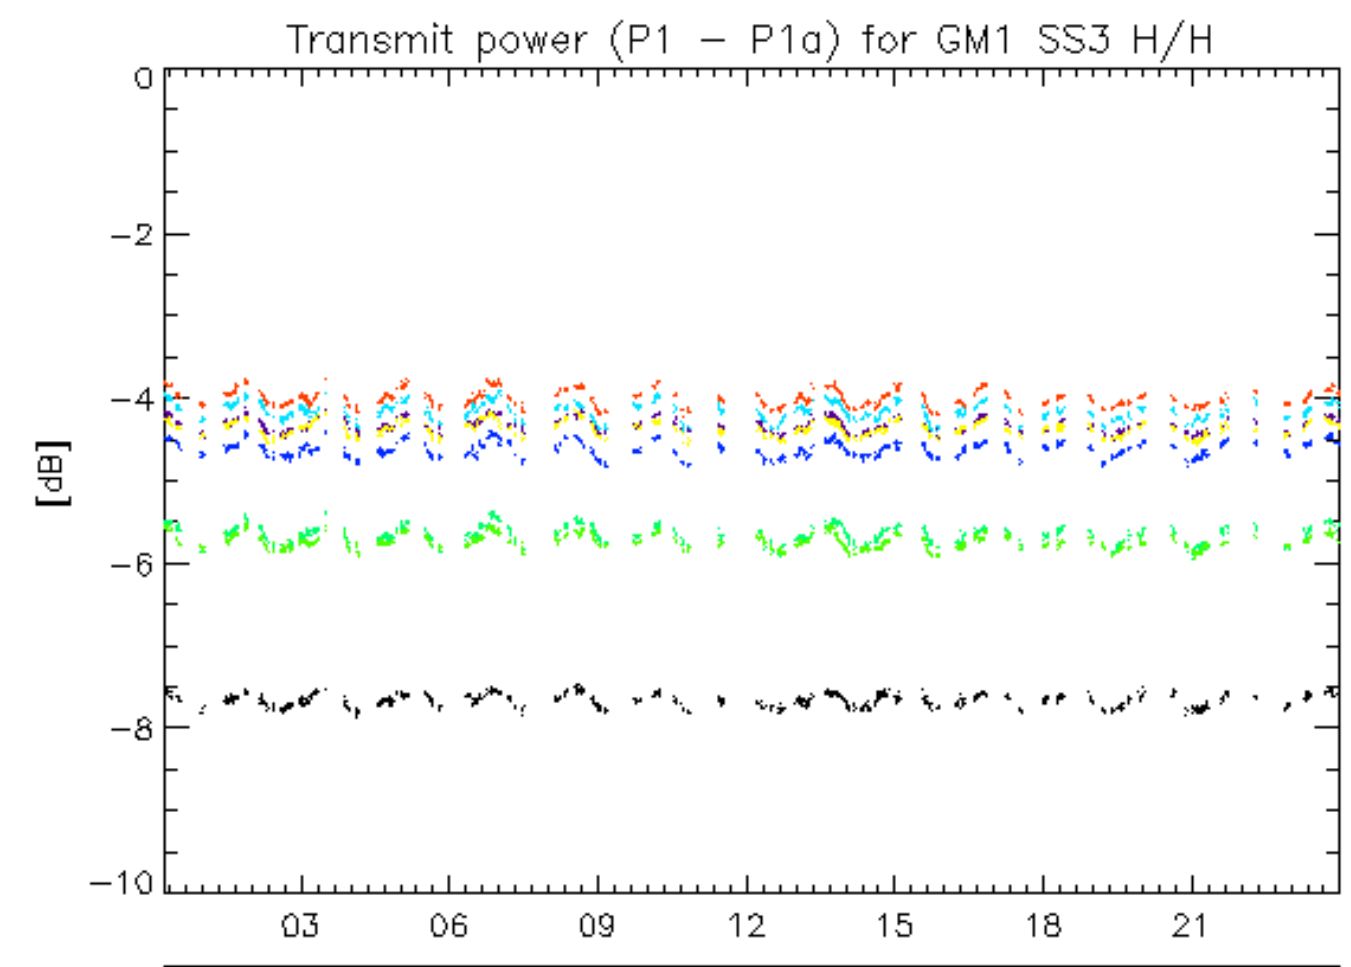


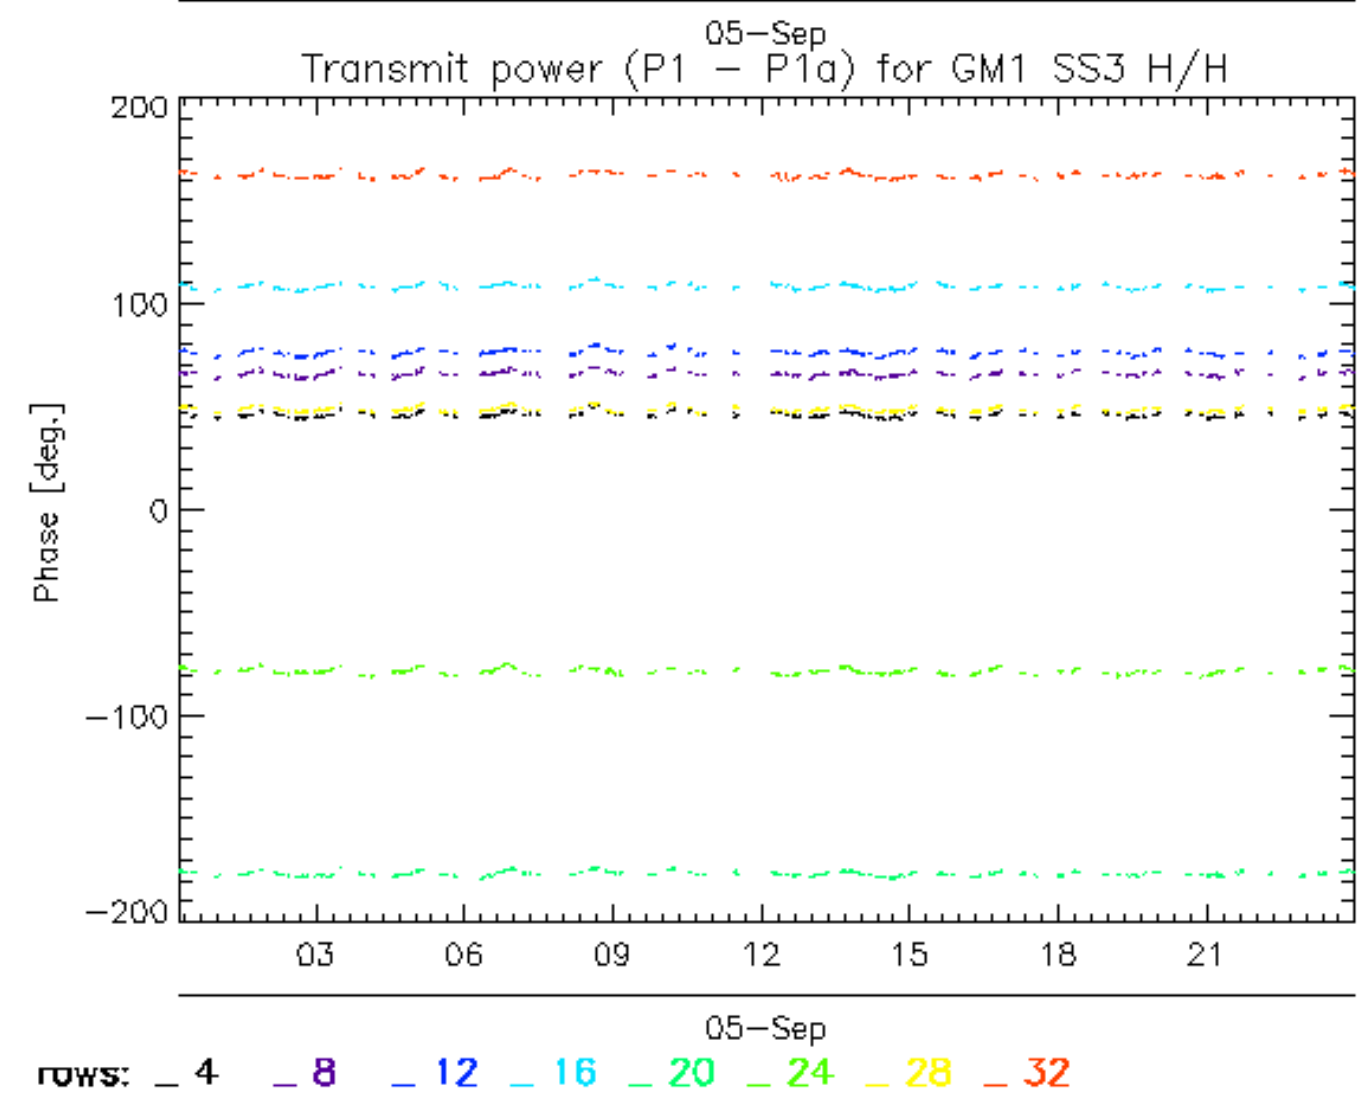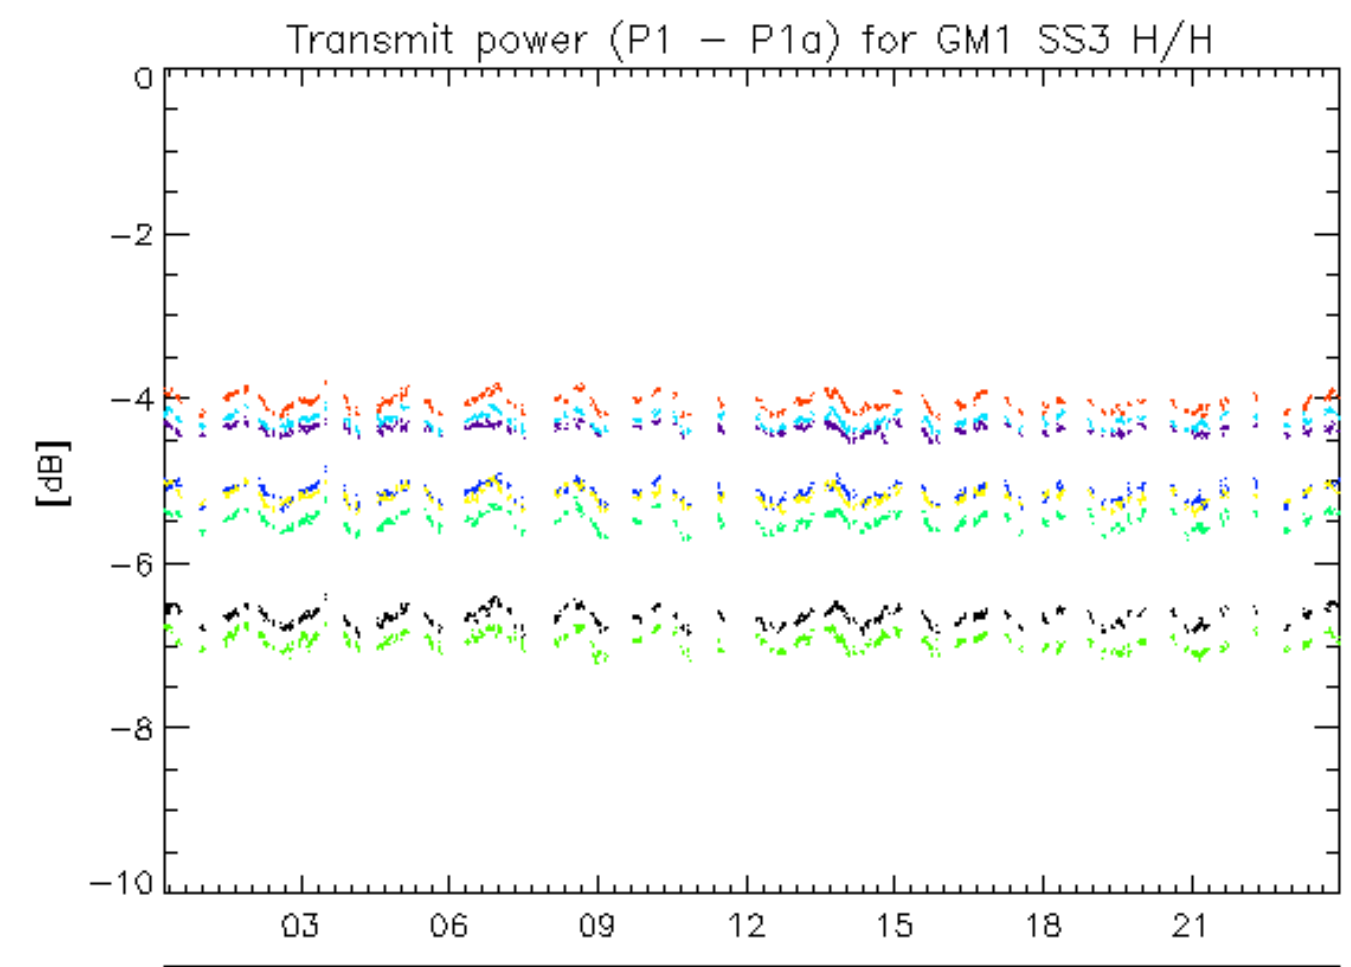





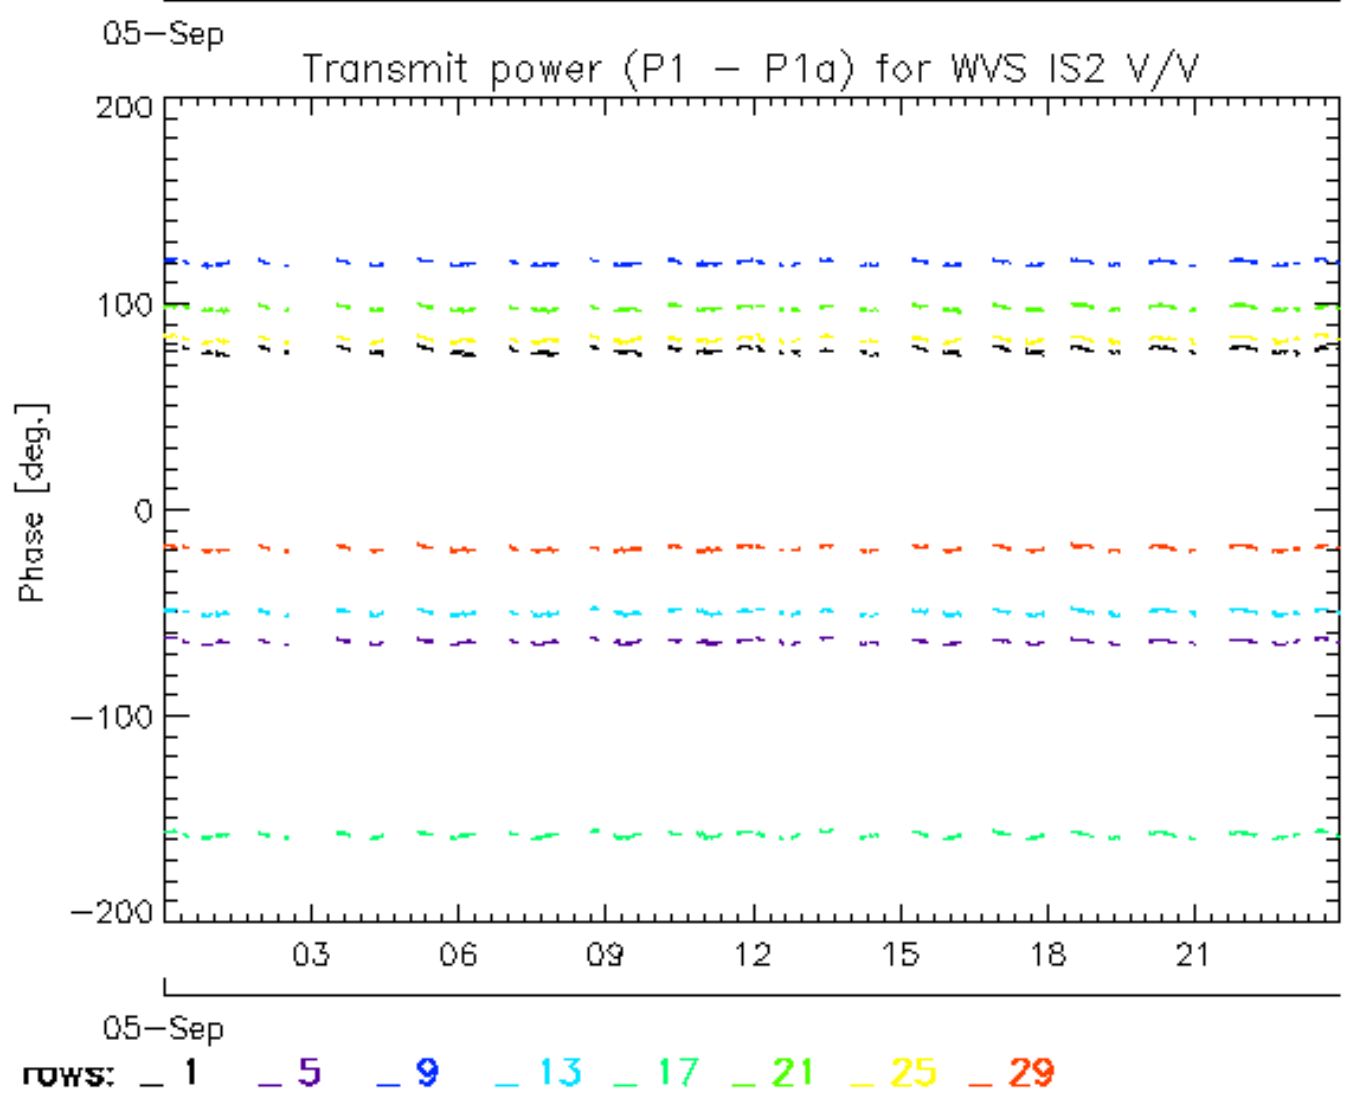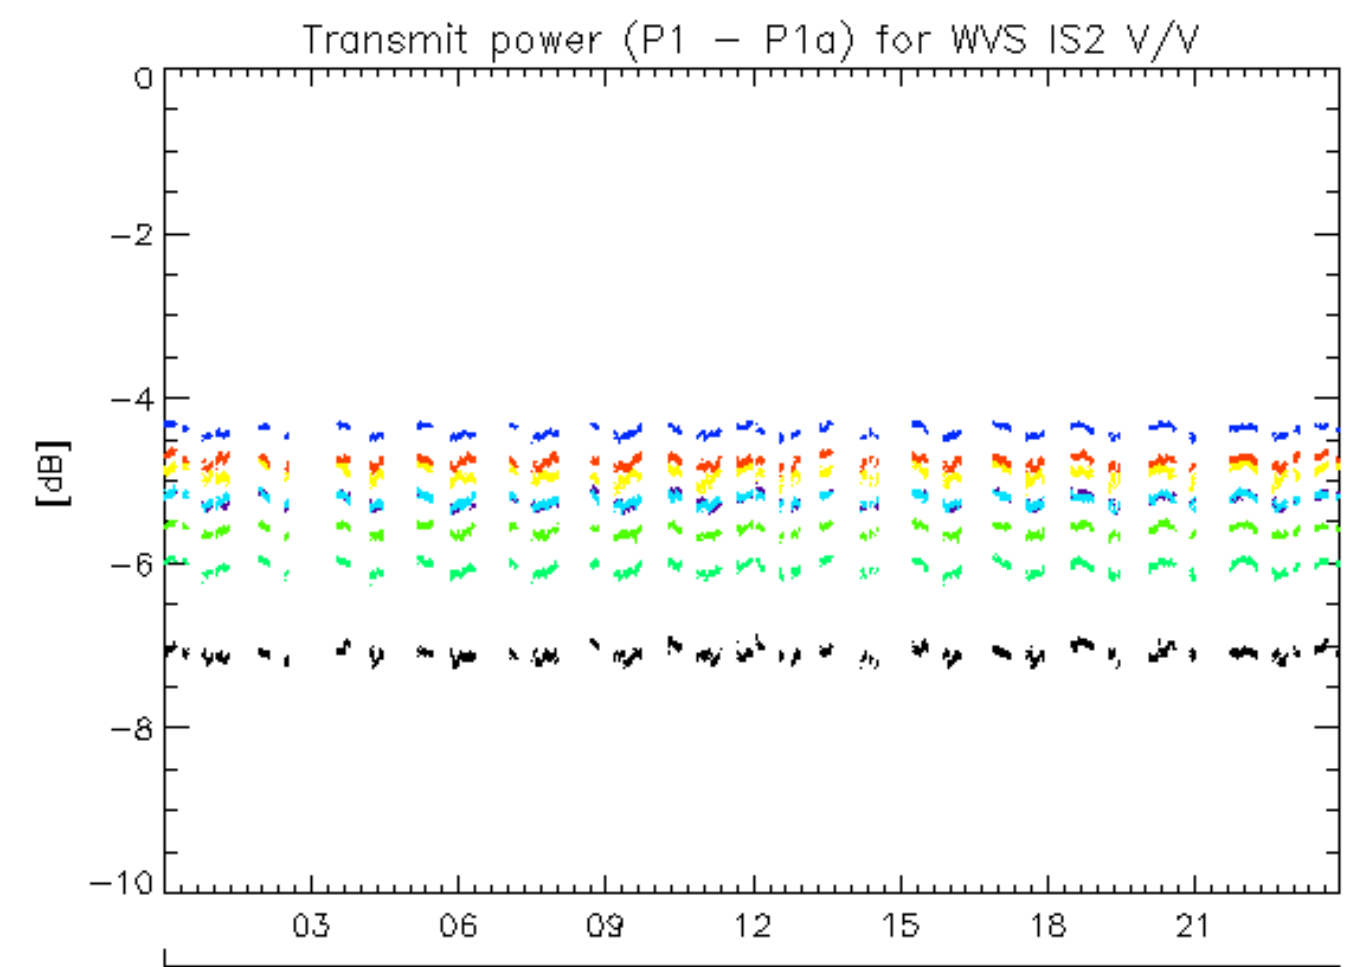

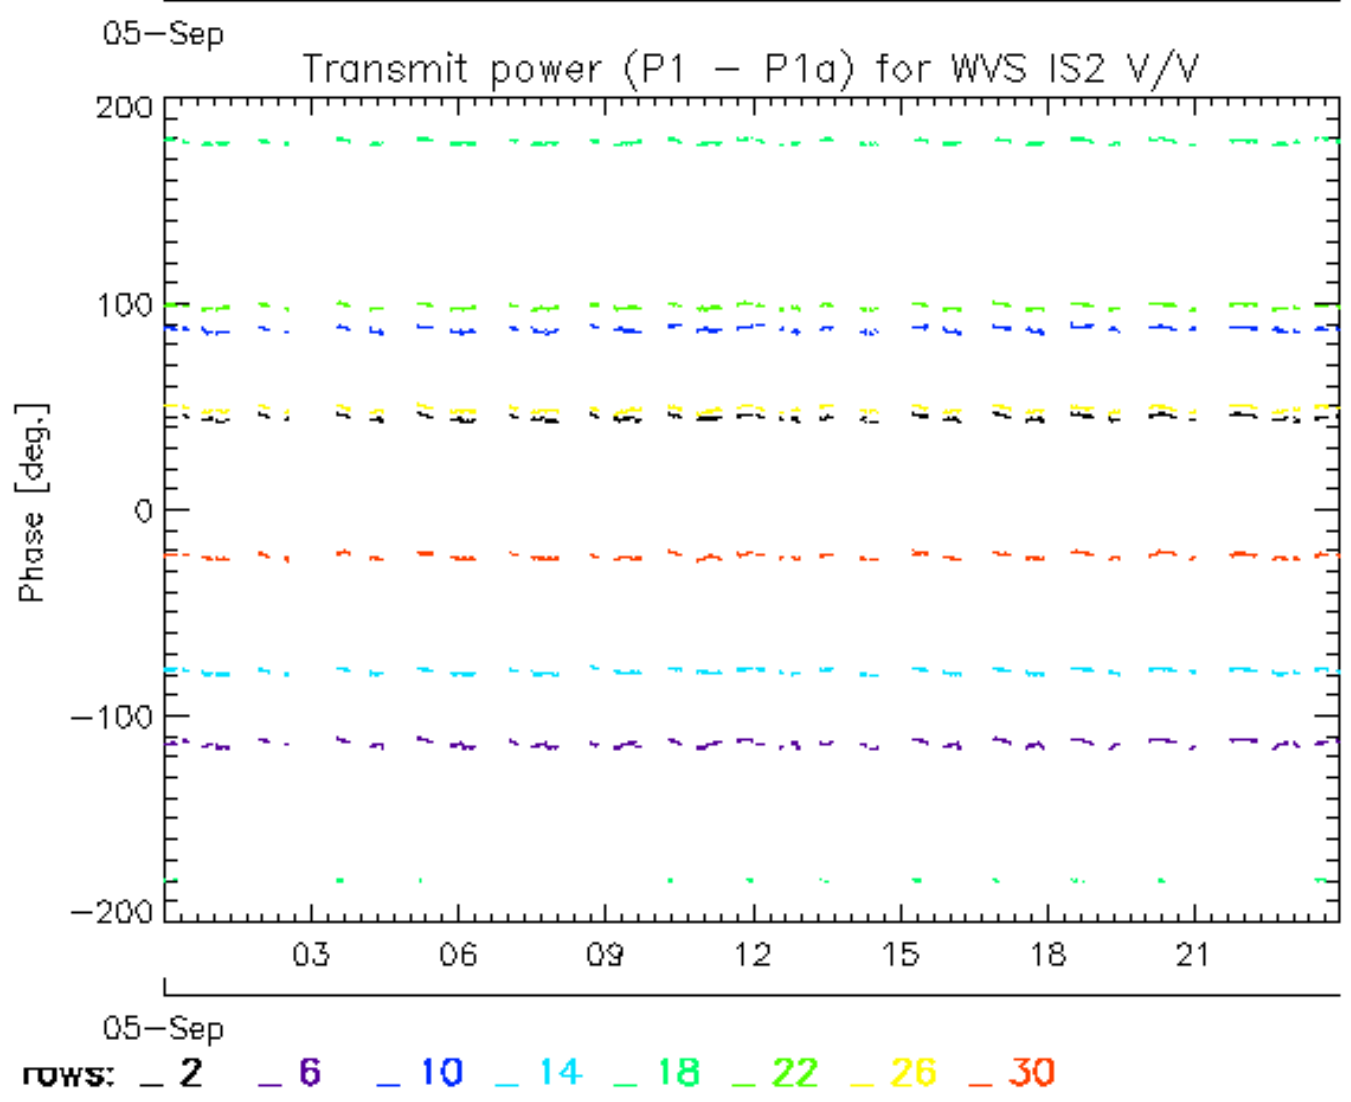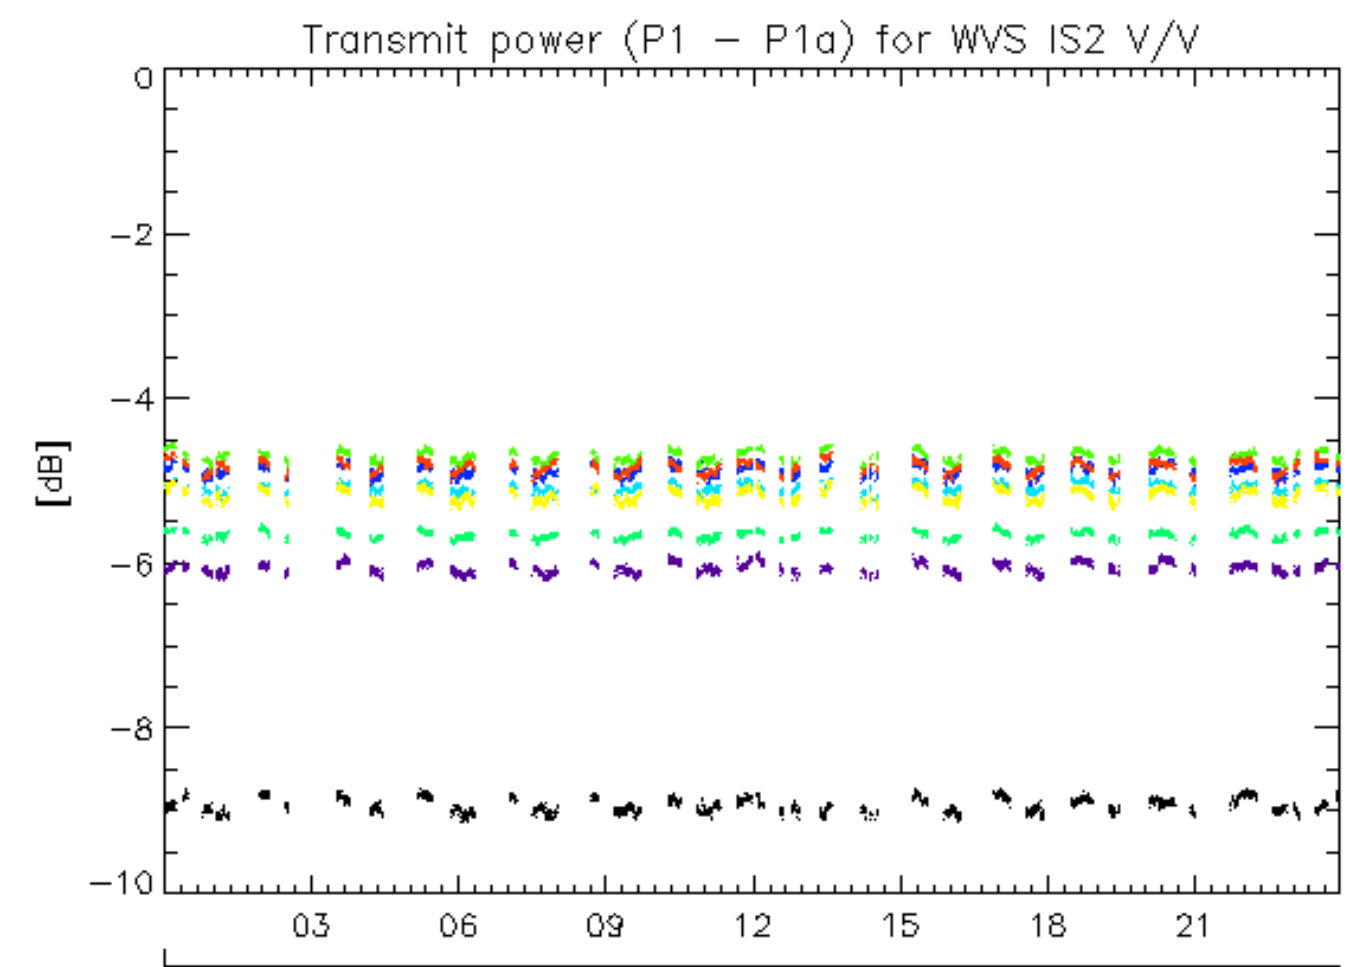


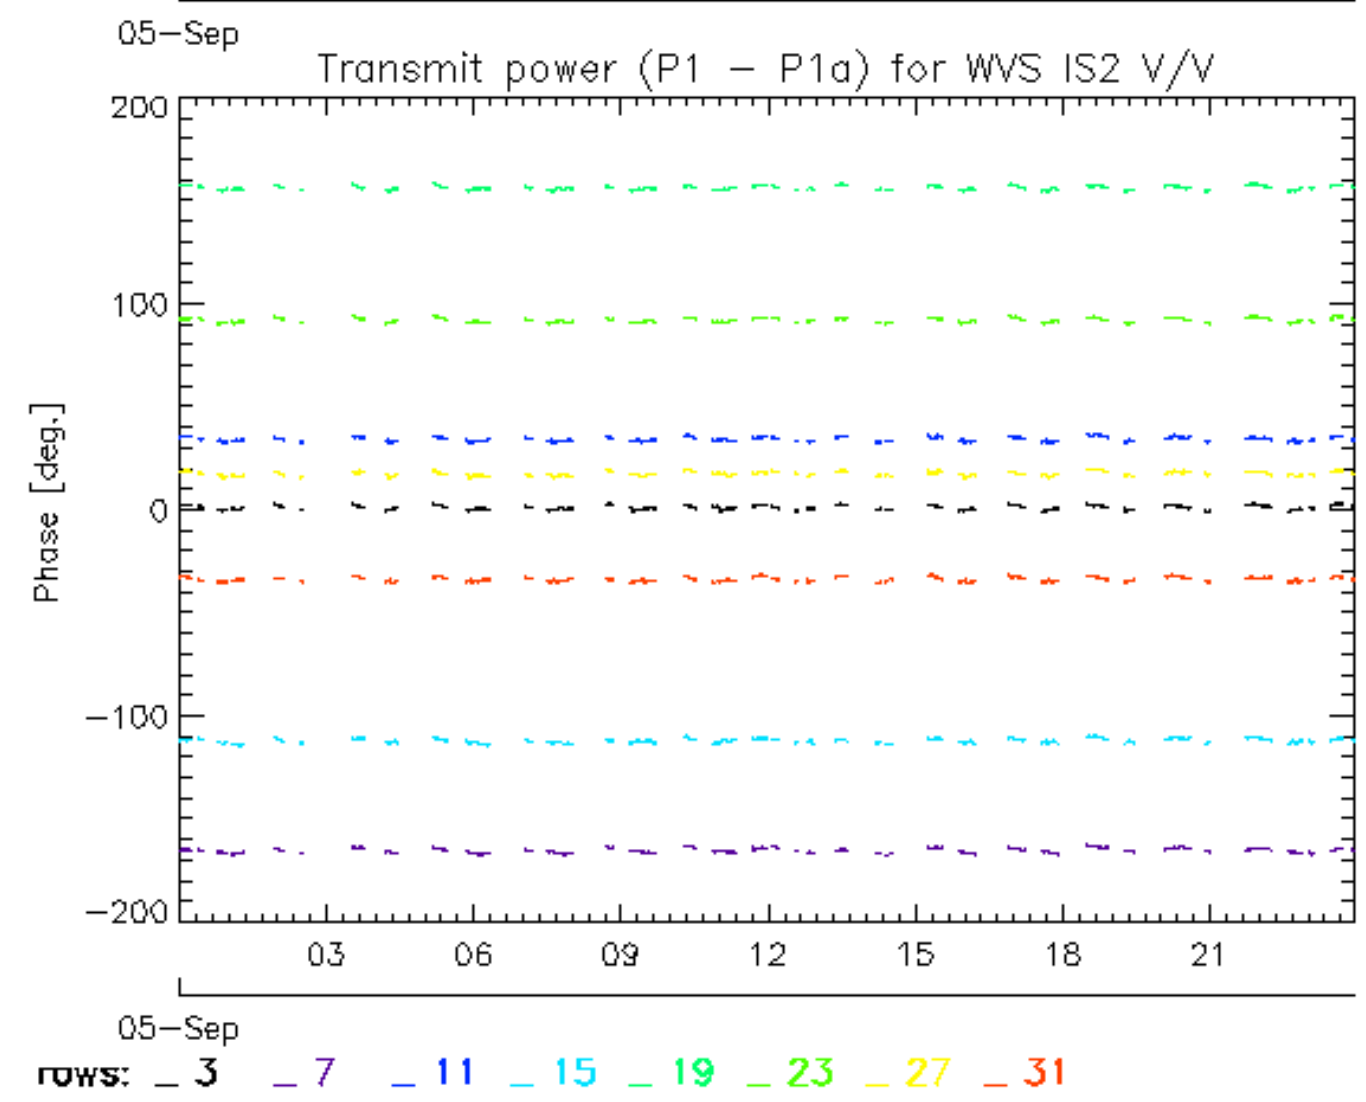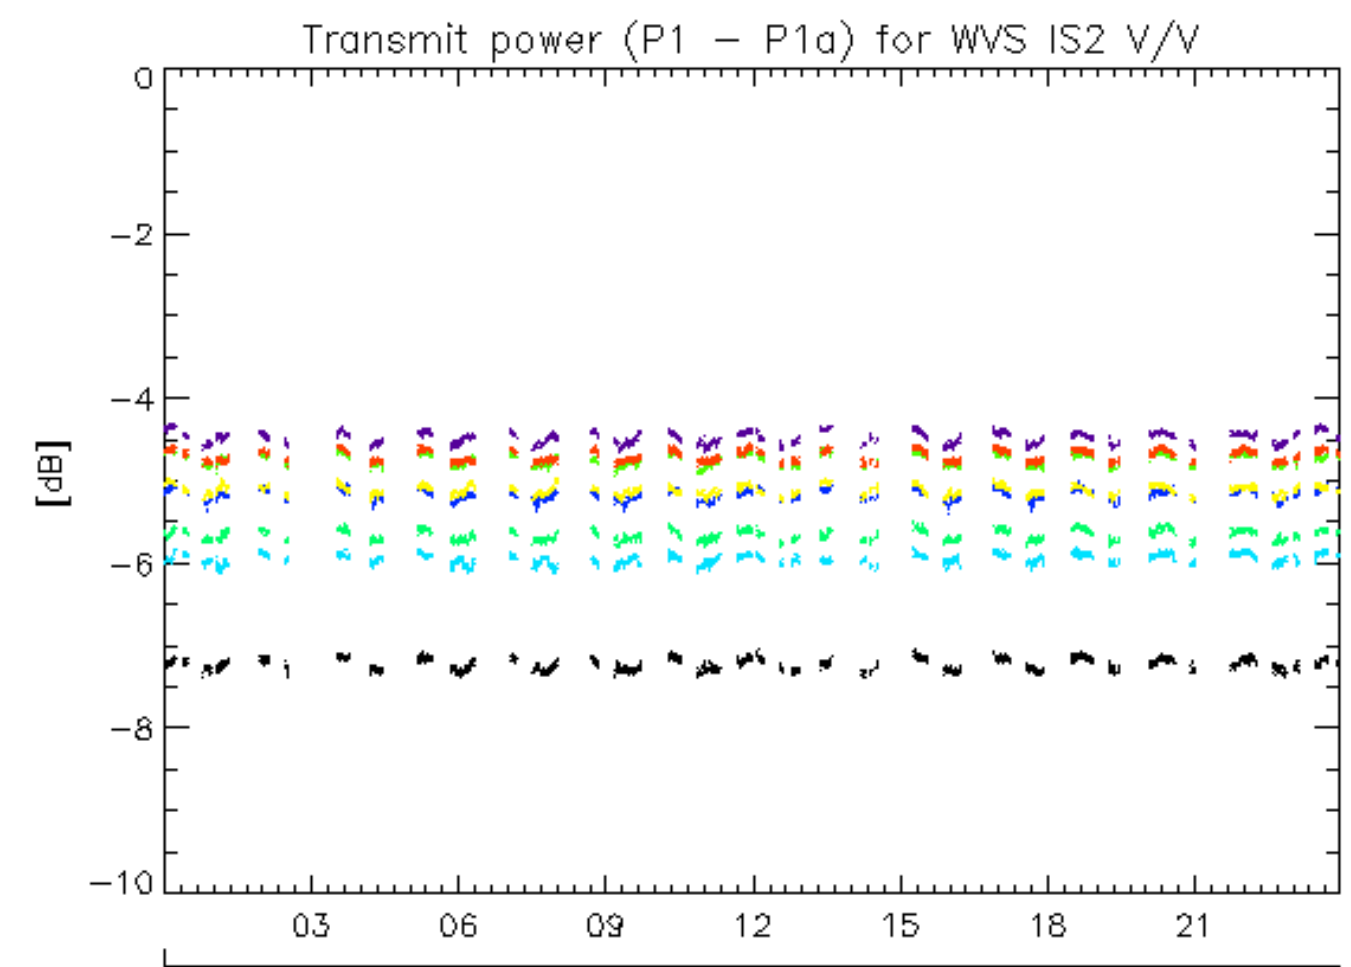





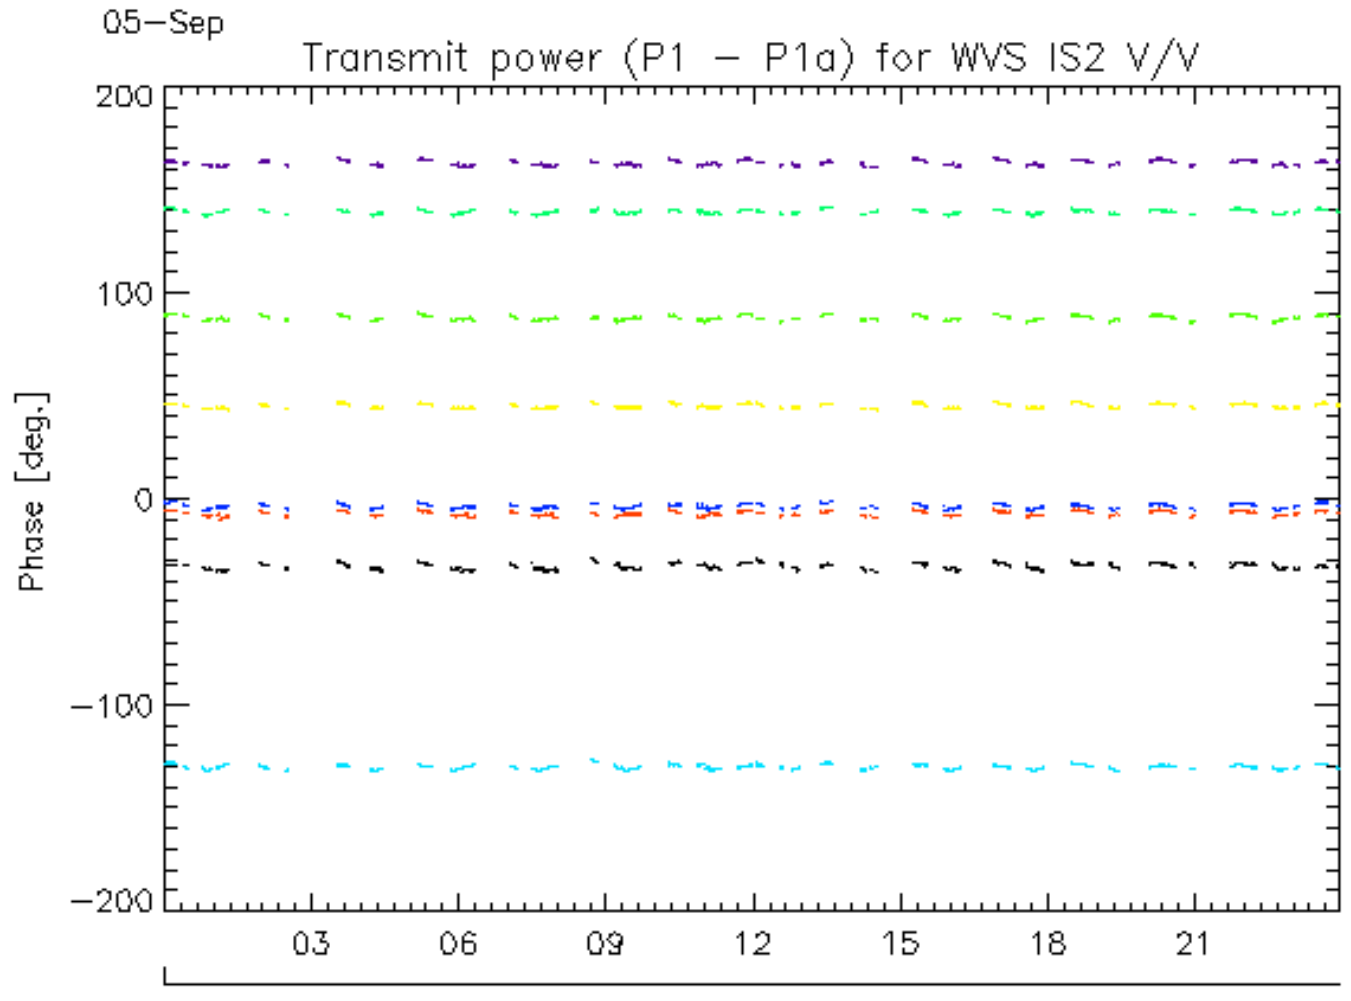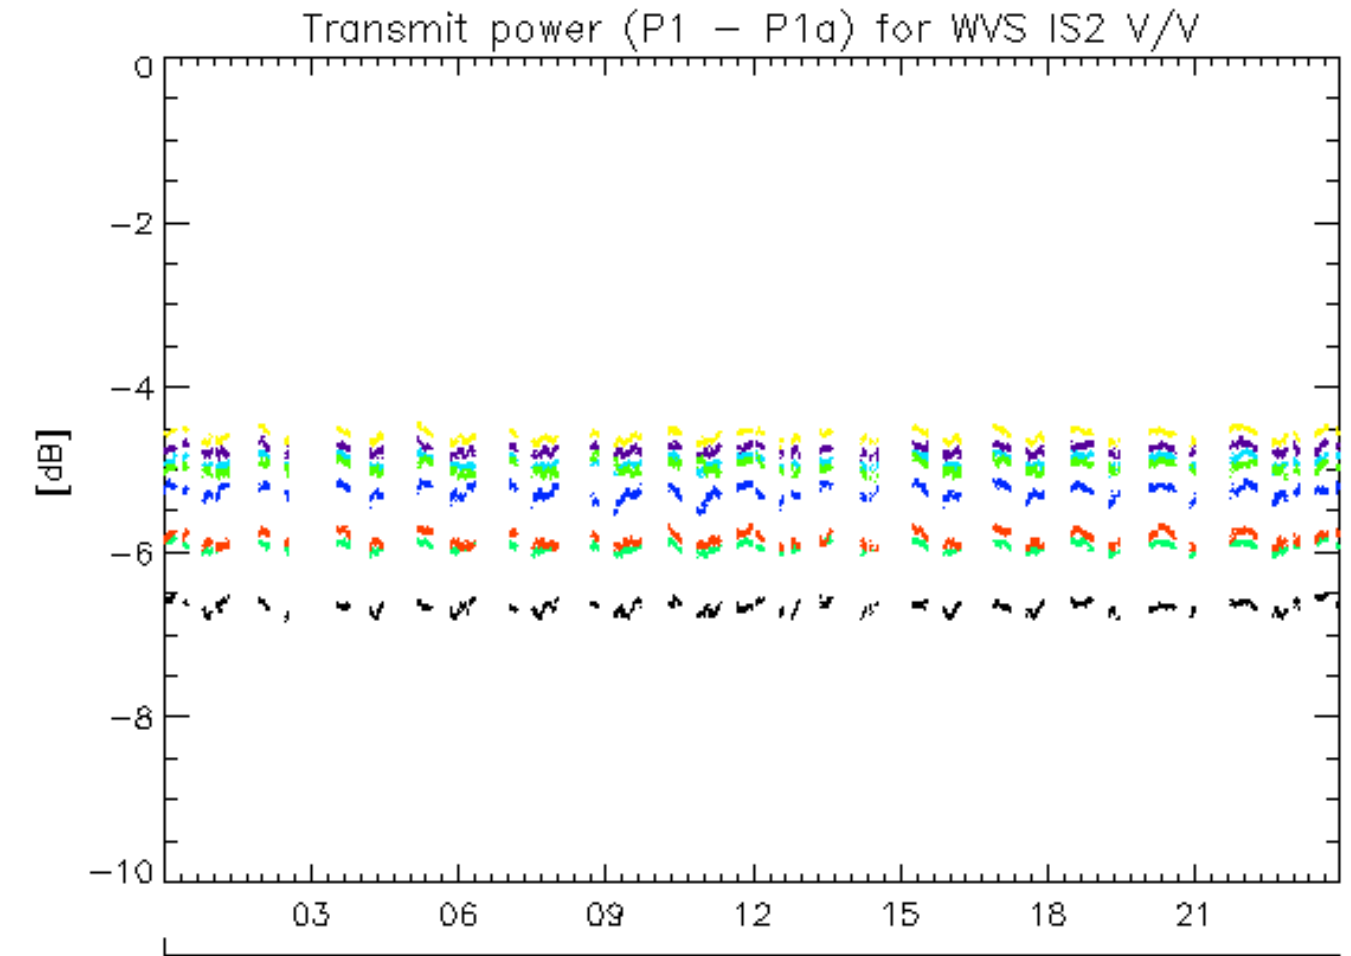


rows: - 4 - 8 - 12 - 16 - 20 - 24 - 28 - 32

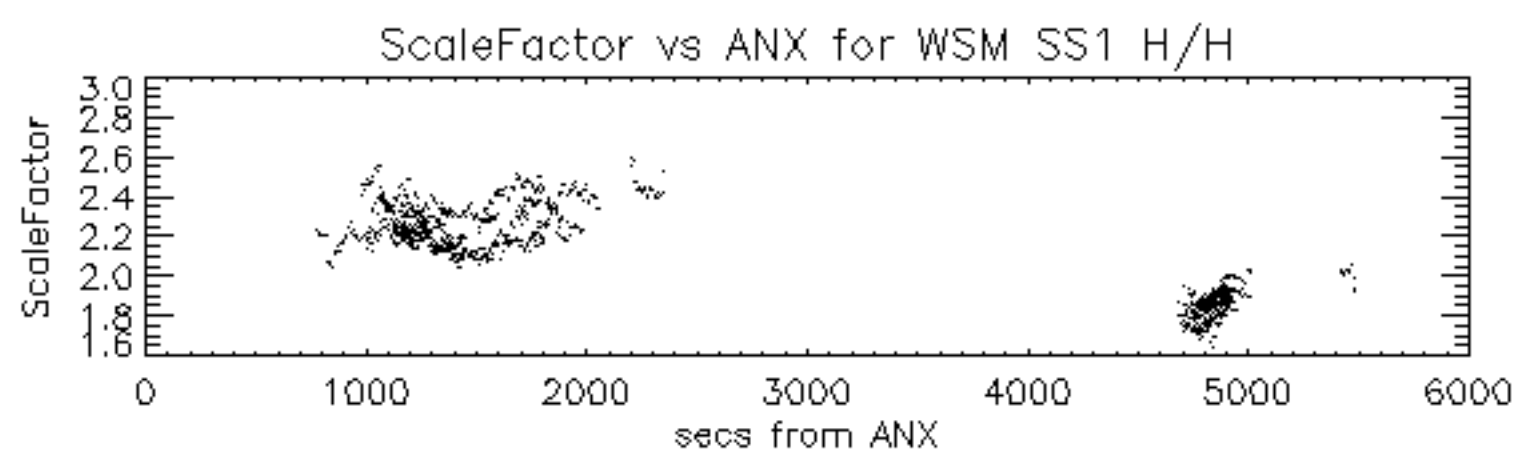

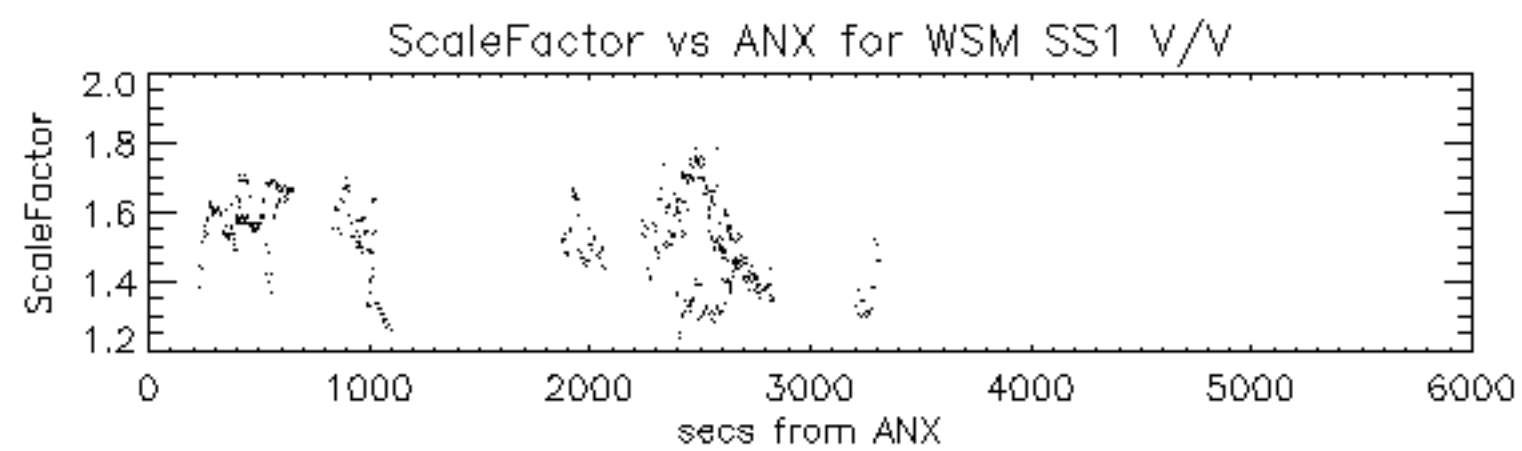

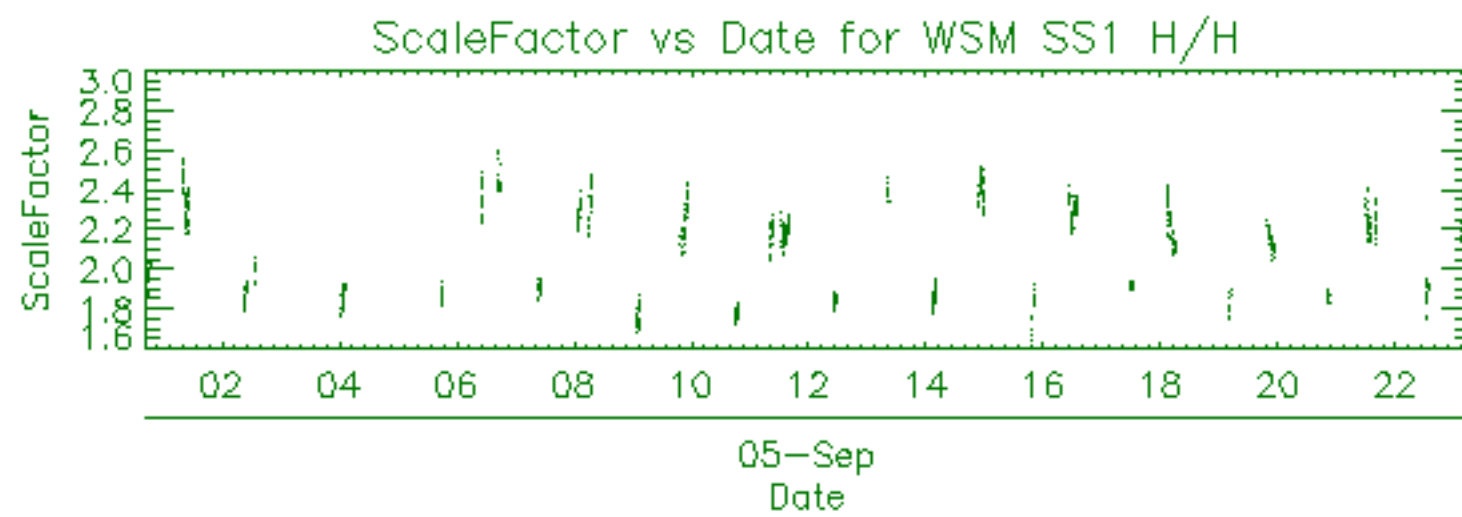



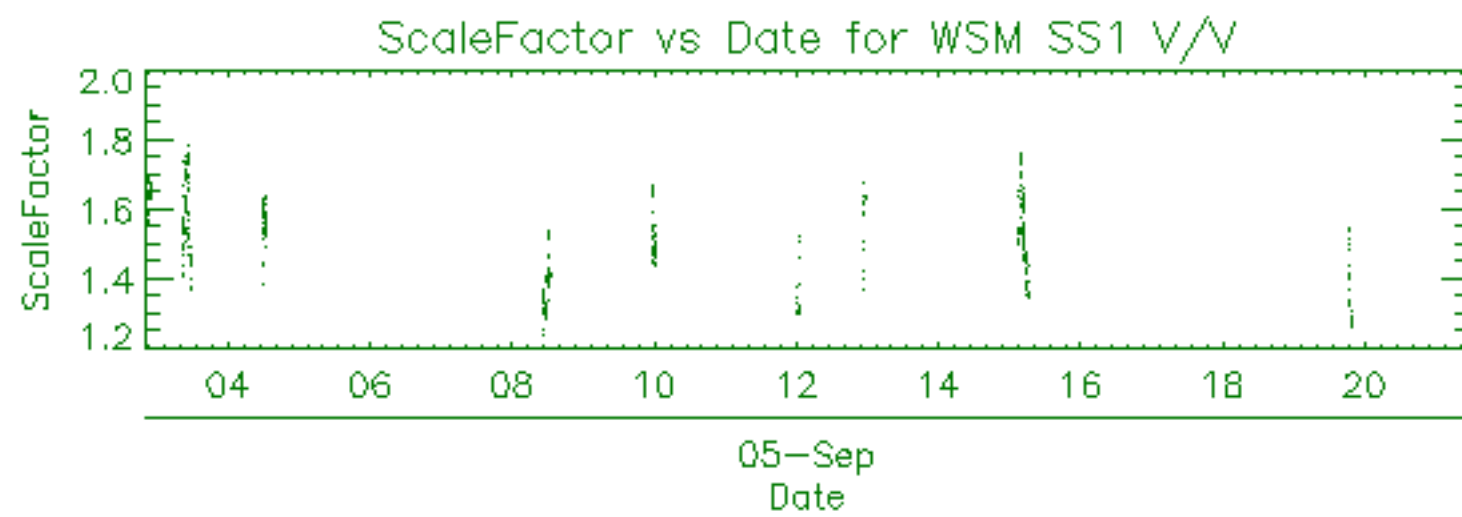

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_GM1_1PNPDE20100905_001402_000005312092_00374_44516_0182.N1						SS1	H/H	92	44516	374	5.03
ASA_GM1_1PNPDE20100905_002839_000002832092_00374_44516_0185.N1						SS1	H/H	92	44516	374	5.03
ASA_GM1_1PNPDE20100905_005803_000002772092_00374_44516_0204.N1						SS1	H/H	92	44516	374	5.03
ASA_GM1_1PNPDE20100905_012704_000010152092_00375_44517_0205.N1						SS1	H/H	92	44517	375	5.03
ASA_GM1_1PNPDE20100905_015030_000003562092_00375_44517_0207.N1						SS1	H/H	92	44517	375	5.03
ASA_GM1_1PNPDE20100905_020916_000006282092_00375_44517_0208.N1						SS1	H/H	92	44517	375	5.03
ASA_GM1_1PNPDE20100905_022542_000001502092_00375_44517_0211.N1						SS1	H/H	92	44517	375	5.03
ASA_GM1_1PNPDE20100905_023515_000003502092_00375_44517_0210.N1						SS1	H/H	92	44517	375	5.03
ASA_GM1_1PNPDE20100905_024235_000004532092_00375_44517_0212.N1						SS1	H/H	92	44517	375	5.03
ASA_GM1_1PNPDE20100905_025655_000004652092_00376_44518_0213.N1						SS1	H/H	92	44518	376	5.03
ASA_GM1_1PNPDE20100905_030527_000009432092_00376_44518_0226.N1						SS1	H/H	92	44518	376	5.03
ASA_GM1_1PNPDE20100905_032855_000000962092_00376_44518_0217.N1						SS1	H/H	92	44518	376	5.03
ASA_GM1_1PNPDE20100905_032855_000000962092_00376_44518_0224.N1						SS1	H/H	92	44518	376	5.03
ASA_GM1_1PNPDE20100905_035142_000004652092_00376_44518_0249.N1						SS1	H/H	92	44518	376	5.03
ASA_GM1_1PNPDE20100905_040604_000002652092_00376_44518_0248.N1						SS1	H/H	92	44518	376	5.03
ASA_GM1_1PNPDE20100905_043302_000011482092_00377_44519_0256.N1						SS1	H/H	92	44519	377	5.03
ASA_GM1_1PNPDE20100905_045546_000000842092_00377_44519_0255.N1						SS1	H/H	92	44519	377	5.03
ASA_GM1_1PNPDE20100905_050032_000005612092_00377_44519_0253.N1						SS1	H/H	92	44519	377	5.03
ASA_GM1_1PNPDE20100905_053029_000000782092_00377_44519_0279.N1						SS1	H/H	92	44519	377	5.03
ASA_GM1_1PNPDE20100905_053314_000004412092_00377_44519_0280.N1						SS1	H/H	92	44519	377	5.03
ASA_GM1_1PNPDE20100905_054551_000002172092_00377_44519_0282.N1						SS1	H/H	92	44519	377	5.03
ASA_GM1_1PNPDE20100905_061908_000003142092_00378_44520_0283.N1						SS1	H/H	92	44520	378	5.03
ASA_GM1_1PNPDE20100905_062701_000004712092_00378_44520_0297.N1						SS1	H/H	92	44520	378	5.03
ASA_GM1_1PNPDE20100905_063607_000003322092_00378_44520_0296.N1						SS1	H/H	92	44520	378	5.03
ASA_GM1_1PNPDE20100905_064449_000001872092_00378_44520_0295.N1						SS1	H/H	92	44520	378	5.03
ASA_GM1_1PNPDE20100905_064859_000004652092_00378_44520_0294.N1						SS1	H/H	92	44520	378	5.03
ASA_GM1_1PNPDE20100905_065743_000002952092_00378_44520_0293.N1						SS1	H/H	92	44520	378	5.03
ASA_GM1_1PNPDK20100905_071106_000002292092_00378_44520_4764.N1						SS1	H/H	92	44520	378	5.03
ASA_GM1_1PNPDK20100905_071859_000001022092_00378_44520_4766.N1						SS1	H/H	92	44520	378	5.03
ASA_GM1_1PNPDK20100905_072647_000001992092_00378_44520_4767.N1						SS1	H/H	92	44520	378	5.03
ASA_GM1_1PNPDK20100905_080723_000003022092_00379_44521_4769.N1						SS1	H/H	92	44521	379	5.03
ASA_GM1_1PNPDK20100905_081344_000000842092_00379_44521_4791.N1						SS1	H/H	92	44521	379	5.03
ASA_GM1_1PNPDK20100905_081918_000002172092_00379_44521_4792.N1						SS1	H/H	92	44521	379	5.03
ASA_GM1_1PNPDK20100905_083213_000006042092_00379_44521_4793.N1						SS1	H/H	92	44521	379	5.03
ASA_GM1_1PNPDK20100905_085140_000007432092_00379_44521_4794.N1						SS1	H/H	92	44521	379	5.03
ASA_GM1_1PNPDK20100905_090803_000001572092_00379_44521_4796.N1						SS1	H/H	92	44521	379	5.03
ASA_GM1_1PNPDK20100905_094340_000003082092_00380_44522_4797.N1						SS1	H/H	92	44522	380	5.03
ASA_GM1_1PNPDK20100905_095032_000001202092_00380_44522_4800.N1						SS1	H/H	92	44522	380	5.03
ASA_GM1_1PNPDK20100905_100654_000005252092_00380_44522_4821.N1						SS1	H/H	92	44522	380	5.03
ASA_GM1_1PNPDK20100905_103215_000001692092_00380_44522_4823.N1						SS1	H/H	92	44522	380	5.03
ASA_GM1_1PNPDK20100905_104128_000001812092_00380_44522_4822.N1						SS1	H/H	92	44522	380	5.03
ASA_GM1_1PNPDK20100905_104825_000001692092_00380_44522_4826.N1						SS1	H/H	92	44522	380	5.03
ASA_GM1_1PNPDK20100905_112451_000004282092_00381_44523_4828.N1						SS1	H/H	92	44523	381	5.03
ASA_GM1_1PNPDK20100905_121255_000001262092_00381_44523_4860.N1						SS1	H/H	92	44523	381	5.03
ASA_GM1_1PNPDK20100905_121754_000003202092_00381_44523_4863.N1						SS1	H/H	92	44523	381	5.03
ASA_GM1_1PNPDK20100905_122922_000001502092_00381_44523_4862.N1						SS1	H/H	92	44523	381	5.03
ASA_GM1_1PNPDK20100905_123804_000005192092_00381_44523_4866.N1						SS1	H/H	92	44523	381	5.03
ASA_GM1_1PNPDK20100905_125912_000009062092_00382_44524_4869.N1						SS1	H/H	92	44524	382	5.03
ASA_GM1_1PNPDK20100905_131337_000002472092_00382_44524_4887.N1						SS1	H/H	92	44524	382	5.03
ASA_GM1_1PNPDK20100905_131915_000000722092_00382_44524_4888.N1						SS1	H/H	92	44524	382	5.03
ASA_GM1_1PNPDK20100905_133557_000006772092_00382_44524_4889.N1						SS1	H/H	92	44524	382	5.03
ASA_GM1_1PNPDK20100905_134720_000011482092_00382_44524_4890.N1						SS1	H/H	92	44524	382	5.03
ASA_GM1_1PNPDK20100905_140955_000001502092_00382_44524_4891.N1						SS1	H/H	92	44524	382	5.03
ASA_GM1_1PNPDK20100905_141823_000002652092_00382_44524_4896.N1						SS1	H/H	92	44524	382	5.03
ASA_GM1_1PNPDK20100905_142459_000003022092_00382_44524_4893.N1						SS1	H/H	92	44524	382	5.03
ASA_GM1_1PNPDK20100905_143425_000009852092_00383_44525_4899.N1						SS1	H/H	92	44525	383	5.03
ASA_GM1_1PNPDK20100905_143425_000009852092_00383_44525_4901.N1						SS1	H/H	92	44525	383	5.03
ASA_GM1_1PNPDK20100905_145221_000000722092_00383_44525_4921.N1						SS1	H/H	92	44525	383	5.03
ASA_GM1_1PNPDK20100905_150001_000004222092_00383_44525_4922.N1						SS1	H/H	92	44525	383	5.03
ASA_GM1_1PNPDK20100905_153404_000007012092_00383_44525_4924.N1						SS1	H/H	92	44525	383	5.03
ASA_GM1_1PNPDK20100905_155039_000001442092_00383_44525_4925.N1						SS1	H/H	92	44525	383	5.03
ASA_GM1_1PNPDK20100905_161410_000002892092_00384_44526_4926.N1						SS1	H/H	92	44526	384	5.03
ASA_GM1_1PNPDK20100905_162007_000003862092_00384_44526_4928.N1						SS1	H/H	92	44526	384	5.03
ASA_GM1_1PNPDK20100905_163546_000009552092_00384_44526_4952.N1						SS1	H/H	92	44526	384	5.03
ASA_GM1_1PNPDK20100905_171439_000002952092_00384_44526_4953.N1						SS1	H/H	92	44526	384	5.03
ASA_GM1_1PNPDK20100905_173140_000001142092_00384_44526_4955.N1						SS1	H/H	92	44526	384	5.03
ASA_GM1_1PNPDK20100905_175945_000003802092_00385_44527_4957.N1						SS1	H/H	92	44527	385	5.03

ASA_GM1_1PNPDK20100905_181556_000005432092_00385_44527_4980.N1	SS1	H/H	92	44527	385	5.03
ASA_GM1_1PNPDK20100905_185513_000002652092_00385_44527_4981.N1	SS1	H/H	92	44527	385	5.03
ASA_GM1_1PNPDK20100905_191146_000001502092_00385_44527_4982.N1	SS1	H/H	92	44527	385	5.03
ASA_GM1_1PNPDK20100905_192234_000001692092_00385_44527_4985.N1	SS1	H/H	92	44527	385	5.03
ASA_GM1_1PNPDK20100905_192857_000005012092_00385_44527_4986.N1	SS1	H/H	92	44527	385	5.03
ASA_GM1_1PNPDK20100905_194248_000001632092_00386_44528_4988.N1	SS1	H/H	92	44528	386	5.03
ASA_GM1_1PNPDE20100905_195557_000001082092_00386_44528_0372.N1	SS1	H/H	92	44528	386	5.03
ASA_GM1_1PNPDE20100905_195955_000002172092_00386_44528_0374.N1	SS1	H/H	92	44528	386	5.03
ASA_GM1_1PNPDE20100905_203554_000002292092_00386_44528_0377.N1	SS1	H/H	92	44528	386	5.03
ASA_GM1_1PNPDE20100905_205249_000000662092_00386_44528_0378.N1	SS1	H/H	92	44528	386	5.03
ASA_GM1_1PNPDE20100905_205251_000001142092_00386_44528_0391.N1	SS1	H/H	92	44528	386	5.03
ASA_GM1_1PNPDE20100905_210042_000011842092_00386_44528_0394.N1	SS1	H/H	92	44528	386	5.03
ASA_GM1_1PNPDE20100905_213458_000002292092_00387_44529_0393.N1	SS1	H/H	92	44529	387	5.03
ASA_GM1_1PNPDE20100905_214124_000001442092_00387_44529_0396.N1	SS1	H/H	92	44529	387	5.03
ASA_GM1_1PNPDE20100905_221627_000001812092_00387_44529_0399.N1	SS1	H/H	92	44529	387	5.03
ASA_GM1_1PNPDE20100905_225212_000003562092_00388_44530_0414.N1	SS1	H/H	92	44530	388	5.03
ASA_GM1_1PNPDE20100905_231545_000006282092_00388_44530_0419.N1	SS1	H/H	92	44530	388	5.03
ASA_GM1_1PNPDE20100905_234207_000001442092_00388_44530_0418.N1	SS1	H/H	92	44530	388	5.03
ASA_GM1_1PNPDE20100905_234602_000002892092_00388_44530_0417.N1	SS1	H/H	92	44530	388	5.03
ASA_GM1_1PNPDE20100905_235057_000000842092_00388_44530_0421.N1	SS1	H/H	92	44530	388	5.03
ASA_GM1_1PNPDE20100905_235701_000001502092_00388_44530_0424.N1	SS1	H/H	92	44530	388	5.03

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20100905_003324_000004432092_00374_44516_0177.N1						IS2	H/H	92	44516	374	5.03
ASA_IMM_1PNPDE20100905_014824_000001132092_00375_44517_0200.N1						IS4	H/H	92	44517	375	5.03
ASA_IMM_1PNPDE20100905_021946_000000922092_00375_44517_0201.N1						IS2	H/H	92	44517	375	5.03
ASA_IMM_1PNPDE20100905_035927_000000922092_00376_44518_0239.N1						IS2	H/H	92	44518	376	5.03
ASA_IMM_1PNPDE20100905_045211_000002032092_00377_44519_0237.N1						IS2	V/V	92	44519	377	5.03
ASA_IMM_1PNPDE20100905_045713_000001892092_00377_44519_0238.N1						IS2	V/V	92	44519	377	5.03
ASA_IMM_1PNPDE20100905_054031_000001622092_00377_44519_0276.N1						IS2	H/H	92	44519	377	5.03
ASA_IMM_1PNPDK20100905_063448_000000632092_00378_44520_4752.N1						IS2	V/V	92	44520	378	5.03
ASA_IMM_1PNPDE20100905_064755_000000512092_00378_44520_0275.N1						IS2	V/V	92	44520	378	5.03
ASA_IMM_1PNPDE20100905_071455_000002322092_00378_44520_0288.N1						IS2	H/H	92	44520	378	5.03
ASA_IMM_1PNPDK20100905_072045_000001622092_00378_44520_4778.N1						IS2	H/H	92	44520	378	5.03
ASA_IMM_1PNPDK20100905_080050_000000922092_00379_44521_4780.N1						IS2	V/V	92	44521	379	5.03
ASA_IMM_1PNPDE20100905_081225_000000682092_00379_44521_0318.N1						IS2	H/H	92	44521	379	5.03
ASA_IMM_1PNPDK20100905_100115_000000972092_00380_44522_4809.N1						IS2	V/V	92	44522	380	5.03
ASA_IMM_1PNPDE20100905_103505_000003732092_00380_44522_0330.N1						IS2	H/H	92	44522	380	5.03
ASA_IMM_1PNPDE20100905_105449_000001422092_00380_44522_0341.N1						IS2	V/V	92	44522	380	5.03
ASA_IMM_1PNPDE20100905_121501_000001622092_00381_44523_0344.N1						IS2	H/H	92	44523	381	5.03
ASA_IMM_1PNPDK20100905_122311_000000922092_00381_44523_4861.N1						IS2	H/H	92	44523	381	5.03
ASA_IMM_1PNPDK20100905_123718_000000372092_00381_44523_4877.N1						IS3	V/V	92	44523	381	5.03
ASA_IMM_1PNPDK20100905_131742_000000822092_00382_44524_4880.N1						IS2	V/V	92	44524	382	5.03
ASA_IMM_1PNPDK20100905_145047_000000832092_00383_44525_4897.N1						IS2	H/H	92	44525	383	5.03
ASA_IMM_1PNPDE20100905_154543_000000922092_00383_44525_0355.N1						IS2	H/H	92	44525	383	5.03
ASA_IMM_1PNPDE20100905_161900_000000592092_00384_44526_0361.N1						IS7	V/V	92	44526	384	5.03
ASA_IMM_1PNPDE20100905_165140_000001392092_00384_44526_0364.N1						IS2	V/V	92	44526	384	5.03
ASA_IMM_1PNPDE20100905_171933_000003022092_00384_44526_0365.N1						IS2	H/H	92	44526	384	5.03
ASA_IMM_1PNPDE20100905_172523_000001942092_00384_44526_0362.N1						IS2	H/H	92	44526	384	5.03
ASA_IMM_1PNPDE20100905_175602_000000372092_00385_44527_0366.N1						IS2	V/V	92	44527	385	5.03
ASA_IMM_1PNPDE20100905_175702_000001552092_00385_44527_0367.N1						IS6	V/V	92	44527	385	5.03
ASA_IMM_1PNPDE20100905_182500_000002392092_00385_44527_0370.N1						IS2	V/V	92	44527	385	5.03
ASA_IMM_1PNPDE20100905_185938_000003022092_00385_44527_0371.N1						IS2	H/H	92	44527	385	5.03
ASA_IMM_1PNPDE20100905_190528_000001622092_00385_44527_0368.N1						IS2	H/H	92	44527	385	5.03
ASA_IMM_1PNPDE20100905_195749_000001142092_00386_44528_0387.N1						IS2	V/V	92	44528	386	5.03
ASA_IMM_1PNPDE20100905_201433_000000442092_00386_44528_0389.N1						IS4	V/V	92	44528	386	5.03
ASA_IMM_1PNPDE20100905_203944_000003022092_00386_44528_0388.N1						IS2	H/H	92	44528	386	5.03
ASA_IMM_1PNPDE20100905_204534_000002332092_00386_44528_0375.N1						IS2	H/H	92	44528	386	5.03
ASA_IMM_1PNPDE20100905_214535_000000392092_00387_44529_0409.N1						IS2	V/V	92	44529	387	5.03
ASA_IMM_1PNPDE20100905_221928_000002322092_00387_44529_0408.N1						IS2	H/H	92	44529	387	5.03
ASA_IMM_1PNPDE20100905_222408_000003032092_00387_44529_0390.N1						IS2	H/H	92	44529	387	5.03
ASA_IMM_1PNPDE20100905_235930_000000912092_00388_44530_0432.N1						IS2	H/H	92	44530	388	5.03




Filename	Pol	Timestamp	count(Module)
ASA_MS__0PNPDE20100905_053156_000000162092_00377_44519_0563.N1	V	2010-09-05 05:31:56	320





Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WSM_1PNPDE20100905_004158_000002812092_00374_44516_0189.N1						SS1	H/H	92	44516	374	5.03
ASA_WSM_1PNPDE20100905_011943_000004282092_00375_44517_0199.N1						SS1	H/H	92	44517	375	5.03
ASA_WSM_1PNPDE20100905_022230_000001842092_00375_44517_0202.N1						SS1	H/H	92	44517	375	5.03
ASA_WSM_1PNPDE20100905_022341_000000922092_00375_44517_0230.N1						SS1	H/H	92	44517	375	5.03
ASA_WSM_1PNPDK20100905_025016_000003002092_00376_44518_4750.N1						SS1	V/V	92	44518	376	5.03
ASA_WSM_1PNPDK20100905_025016_000003002092_00376_44518_4737.N1						SS1	V/V	92	44518	376	5.03
ASA_WSM_1PNPDE20100905_025135_000002202092_00376_44518_0234.N1						SS1	V/V	92	44518	376	5.03
ASA_WSM_1PNPDE20100905_032118_000004532092_00376_44518_0215.N1						SS1	V/V	92	44518	376	5.03
ASA_WSM_1PNPDE20100905_032118_000004532092_00376_44518_0222.N1						SS1	V/V	92	44518	376	5.03
ASA_WSM_1PNPDE20100905_040159_000002452092_00376_44518_0240.N1						SS1	H/H	92	44518	376	5.03
ASA_WSM_1PNPDK20100905_042823_000002752092_00377_44519_4751.N1						SS1	V/V	92	44519	377	5.03
ASA_WSM_1PNPDK20100905_042823_000002752092_00377_44519_4749.N1						SS1	V/V	92	44519	377	5.03
ASA_WSM_1PNPDE20100905_042854_000002452092_00377_44519_0241.N1						SS1	V/V	92	44519	377	5.03
ASA_WSM_1PNPDE20100905_054328_000001282092_00377_44519_0277.N1						SS1	H/H	92	44519	377	5.03
ASA_WSM_1PNPDE20100905_062426_000001472092_00378_44520_0278.N1						SS1	H/H	92	44520	378	5.03
ASA_WSM_1PNPDE20100905_064148_000001772092_00378_44520_0274.N1						SS1	H/H	92	44520	378	5.03
ASA_WSM_1PNPDK20100905_072343_000001772092_00378_44520_4779.N1						SS1	H/H	92	44520	378	5.03
ASA_WSM_1PNPDK20100905_080343_000002142092_00379_44521_4781.N1						SS1	H/H	92	44521	379	5.03
ASA_WSM_1PNPDE20100905_081520_000002322092_00379_44521_0319.N1						SS1	H/H	92	44521	379	5.03
ASA_WSM_1PNPDE20100905_082542_000003852092_00379_44521_0320.N1						SS1	V/V	92	44521	379	5.03
ASA_WSM_1PNPDK20100905_090408_000002322092_00379_44521_4807.N1						SS1	H/H	92	44521	379	5.03
ASA_WSM_1PNPDK20100905_094853_000000922092_00380_44522_4810.N1						SS1	H/H	92	44522	380	5.03
ASA_WSM_1PNPDE20100905_095243_000002392092_00380_44522_0327.N1						SS1	H/H	92	44522	380	5.03
ASA_WSM_1PNPDE20100905_095737_000002142092_00380_44522_0328.N1						SS1	V/V	92	44522	380	5.03
ASA_WSM_1PNPDK20100905_095747_000000982092_00380_44522_4811.N1						SS1	V/V	92	44522	380	5.03
ASA_WSM_1PNPDE20100905_104434_000002262092_00380_44522_0340.N1						SS1	H/H	92	44522	380	5.03
ASA_WSM_1PNPDE20100905_111957_000002882092_00381_44523_0342.N1						SS1	H/H	92	44523	381	5.03
ASA_WSM_1PNPDK20100905_113208_000003062092_00381_44523_4837.N1						SS1	H/H	92	44523	381	5.03
ASA_WSM_1PNPDK20100905_113806_000001282092_00381_44523_4840.N1						SS1	H/H	92	44523	381	5.03
ASA_WSM_1PNPDE20100905_120028_000001222092_00381_44523_0343.N1						SS1	V/V	92	44523	381	5.03
ASA_WSM_1PNPDK20100905_122534_000002262092_00381_44523_4868.N1						SS1	H/H	92	44523	381	5.03
ASA_WSM_1PNPDK20100905_125626_000000862092_00382_44524_4879.N1						SS1	V/V	92	44524	382	5.03
ASA_WSM_1PNPDE20100905_132039_000000922092_00382_44524_0357.N1						SS1	H/H	92	44524	382	5.03
ASA_WSM_1PNPDE20100905_140635_000001842092_00382_44524_0358.N1						SS1	H/H	92	44524	382	5.03
ASA_WSM_1PNPDK20100905_145345_000002812092_00383_44525_4908.N1						SS1	H/H	92	44525	383	5.03
ASA_WSM_1PNPDE20100905_145644_000001842092_00383_44525_0359.N1						SS1	H/H	92	44525	383	5.03
ASA_WSM_1PNPDK20100905_150710_000005082092_00383_44525_4938.N1						SS1	V/V	92	44525	383	5.03
ASA_WSM_1PNPDE20100905_151038_000001592092_00383_44525_0360.N1						SS1	V/V	92	44525	383	5.03
ASA_WSM_1PNPDE20100905_154836_000001222092_00383_44525_0356.N1						SS1	H/H	92	44525	383	5.03
ASA_WSM_1PNPDK20100905_162637_000005442092_00384_44526_4937.N1						SS1	H/H	92	44526	384	5.03
ASA_WSM_1PNPDE20100905_172925_000001282092_00384_44526_0363.N1						SS1	H/H	92	44526	384	5.03
ASA_WSM_1PNPDK20100905_180609_000005812092_00385_44527_4967.N1						SS1	H/H	92	44527	385	5.03
ASA_WSM_1PNPDE20100905_190926_000001282092_00385_44527_0369.N1						SS1	H/H	92	44527	385	5.03
ASA_WSM_1PNPDK20100905_194539_000001772092_00386_44528_4995.N1						SS1	V/V	92	44528	386	5.03
ASA_WSM_1PNPDK20100905_194901_000000862092_00386_44528_4996.N1						SS1	H/H	92	44528	386	5.03
ASA_WSM_1PNPDK20100905_195105_000002882092_00386_44528_4999.N1						SS1	H/H	92	44528	386	5.03
ASA_WSM_1PNPDE20100905_205027_000001282092_00386_44528_0386.N1						SS1	H/H	92	44528	386	5.03
ASA_WSM_1PNPDK20100905_212431_000002202092_00387_44529_5022.N1						SS1	V/V	92	44529	387	5.03
ASA_WSM_1PNPDK20100905_212941_000003062092_00387_44529_5024.N1						SS1	H/H	92	44529	387	5.03
ASA_WSM_1PNPDE20100905_213853_000001472092_00387_44529_0402.N1						SS1	H/H	92	44529	387	5.03
ASA_WSM_1PNPDE20100905_223018_000002452092_00387_44529_0407.N1						SS1	H/H	92	44529	387	5.03
ASA_WSM_1PNPDK20100905_230757_000003552092_00388_44530_5030.N1						SS1	H/H	92	44530	388	5.03
ASA_WSM_1PNPDE20100905_231300_000001592092_00388_44530_0431.N1						SS1	H/H	92	44530	388	5.03


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20100904_235919_000008392092_00374_44516_0181.N1						IS2	V/V	92	44516	374	5.03
ASA_WVS_1PNPDE20100905_002256_000003002092_00374_44516_0183.N1						IS2	V/V	92	44516	374	5.03
ASA_WVS_1PNPDE20100905_004734_000003142092_00374_44516_0184.N1						IS2	V/V	92	44516	374	5.03
ASA_WVS_1PNPDE20100905_005204_000003142092_00374_44516_0203.N1						IS2	V/V	92	44516	374	5.03
ASA_WVS_1PNPDE20100905_004734_000003142092_00374_44516_0184.N1						IS1	V/V	92	44516	374	5.03
ASA_WVS_1PNPDE20100905_010244_000009292092_00374_44516_0206.N1						IS2	V/V	92	44516	374	5.03
ASA_WVS_1PNPDE20100905_015627_000007192092_00375_44517_0209.N1						IS2	V/V	92	44517	375	5.03
ASA_WVS_1PNPDE20100905_022819_000002252092_00375_44517_0225.N1						IS2	V/V	92	44517	375	5.03
ASA_WVS_1PNPDE20100905_033039_000000742092_00376_44518_0223.N1						IS2	V/V	92	44518	376	5.03
ASA_WVS_1PNPDE20100905_033039_000000742092_00376_44518_0216.N1						IS2	V/V	92	44518	376	5.03
ASA_WVS_1PNPDE20100905_033139_000009292092_00376_44518_0247.N1						IS2	V/V	92	44518	376	5.03
ASA_WVS_1PNPDE20100905_041033_000010192092_00376_44518_0254.N1						IS2	V/V	92	44518	376	5.03
ASA_WVS_1PNPDE20100905_050956_000010042092_00377_44519_0252.N1						IS2	V/V	92	44519	377	5.03
ASA_WVS_1PNPDE20100905_052610_000000302092_00377_44519_0281.N1						IS2	V/V	92	44519	377	5.03
ASA_WVS_1PNPDE20100905_050956_000010042092_00377_44519_0252.N1						IS1	V/V	92	44519	377	5.03
ASA_WVS_1PNPDE20100905_054931_000017392092_00377_44519_0292.N1						IS2	V/V	92	44519	377	5.03
ASA_WVS_1PNPDE20100905_070244_000002552092_00378_44520_0291.N1						IS2	V/V	92	44520	378	5.03
ASA_WVS_1PNPDK20100905_070629_000002252092_00378_44520_4765.N1						IS2	V/V	92	44520	378	5.03
ASA_WVS_1PNPDE20100905_070244_000002552092_00378_44520_0291.N1						IS1	V/V	92	44520	378	5.03
ASA_WVS_1PNPDK20100905_073007_000017992092_00378_44520_4768.N1						IS2	V/V	92	44520	378	5.03
ASA_WVS_1PNPDK20100905_084217_000005242092_00379_44521_4795.N1						IS2	V/V	92	44521	379	5.03
ASA_WVS_1PNPDK20100905_091043_000019342092_00379_44521_4799.N1						IS2	V/V	92	44521	379	5.03
ASA_WVS_1PNPDK20100905_101541_000009442092_00380_44522_4825.N1						IS2	V/V	92	44522	380	5.03
ASA_WVS_1PNPDK20100905_105119_000001802092_00380_44522_4824.N1						IS2	V/V	92	44522	380	5.03
ASA_WVS_1PNPDK20100905_105717_000013192092_00380_44522_4827.N1						IS2	V/V	92	44522	380	5.03
ASA_WVS_1PNPDK20100905_114024_000010792092_00381_44523_4859.N1						IS2	V/V	92	44523	381	5.03
ASA_WVS_1PNPDK20100905_120432_000004502092_00381_44523_4864.N1						IS2	V/V	92	44523	381	5.03
ASA_WVS_1PNPDK20100905_123155_000002552092_00381_44523_4865.N1						IS2	V/V	92	44523	381	5.03
ASA_WVS_1PNPDK20100905_124644_000005442092_00381_44523_4867.N1						IS2	V/V	92	44523	381	5.03
ASA_WVS_1PNPDK20100905_132213_000007792092_00382_44524_4895.N1						IS2	V/V	92	44524	382	5.03
ASA_WVS_1PNPDK20100905_141230_000003152092_00382_44524_4894.N1						IS2	V/V	92	44524	382	5.03
ASA_WVS_1PNPDK20100905_142252_000000892092_00382_44524_4892.N1						IS2	V/V	92	44524	382	5.03
ASA_WVS_1PNPDK20100905_143003_000001192092_00383_44525_4898.N1						IS2	V/V	92	44525	383	5.03
ASA_WVS_1PNPDK20100905_143003_000001192092_00383_44525_4900.N1						IS2	V/V	92	44525	383	5.03
ASA_WVS_1PNPDK20100905_151539_000010642092_00383_44525_4923.N1						IS2	V/V	92	44525	383	5.03
ASA_WVS_1PNPDK20100905_155306_000012142092_00383_44525_4927.N1						IS2	V/V	92	44525	383	5.03
ASA_WVS_1PNPDK20100905_165404_000011842092_00384_44526_4954.N1						IS2	V/V	92	44526	384	5.03
ASA_WVS_1PNPDK20100905_173342_000013042092_00384_44526_4956.N1						IS2	V/V	92	44526	384	5.03
ASA_WVS_1PNPDK20100905_182906_000015292092_00385_44527_4983.N1						IS2	V/V	92	44527	385	5.03
ASA_WVS_1PNPDK20100905_191418_000004502092_00385_44527_4984.N1						IS2	V/V	92	44527	385	5.03
ASA_WVS_1PNPDK20100905_192525_000001642092_00385_44527_4987.N1						IS2	V/V	92	44527	385	5.03
ASA_WVS_1PNPDE20100905_200334_000006142092_00386_44528_0373.N1						IS2	V/V	92	44528	386	5.03
ASA_WVS_1PNPDE20100905_201523_000011842092_00386_44528_0376.N1						IS2	V/V	92	44528	386	5.03
ASA_WVS_1PNPDE20100905_205454_000003002092_00386_44528_0392.N1						IS2	V/V	92	44528	386	5.03
ASA_WVS_1PNPDE20100905_214354_000000602092_00387_44529_0395.N1						IS2	V/V	92	44529	387	5.03
ASA_WVS_1PNPDE20100905_214620_000017692092_00387_44529_0397.N1						IS2	V/V	92	44529	387	5.03
ASA_WVS_1PNPDE20100905_223521_000002242092_00387_44529_0398.N1						IS2	V/V	92	44529	387	5.03
ASA_WVS_1PNPDE20100905_223806_000007942092_00387_44529_0413.N1						IS2	V/V	92	44529	387	5.03
ASA_WVS_1PNPDE20100905_223521_000002242092_00387_44529_0398.N1						IS1	V/V	92	44529	387	5.03
ASA_WVS_1PNPDE20100905_230111_000003602092_00388_44530_0420.N1						IS2	V/V	92	44530	388	5.03
ASA_WVS_1PNPDE20100905_232618_000009142092_00388_44530_0416.N1						IS2	V/V	92	44530	388	5.03
ASA_WVS_1PNPDE20100905_235228_000002252092_00388_44530_0422.N1						IS2	V/V	92	44530	388	5.03



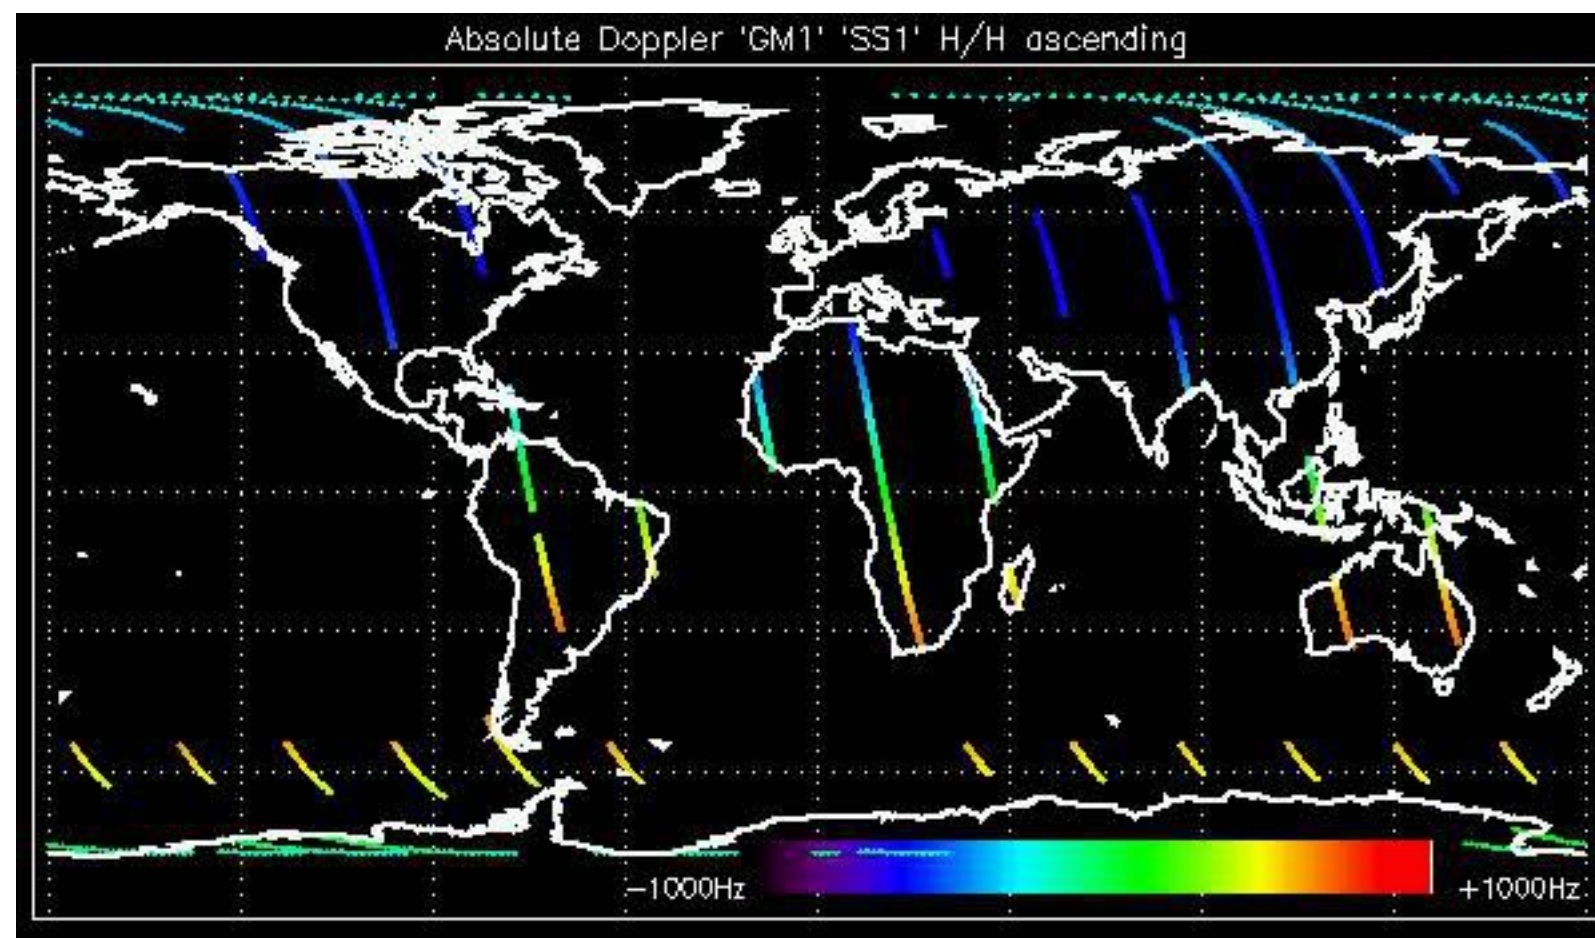






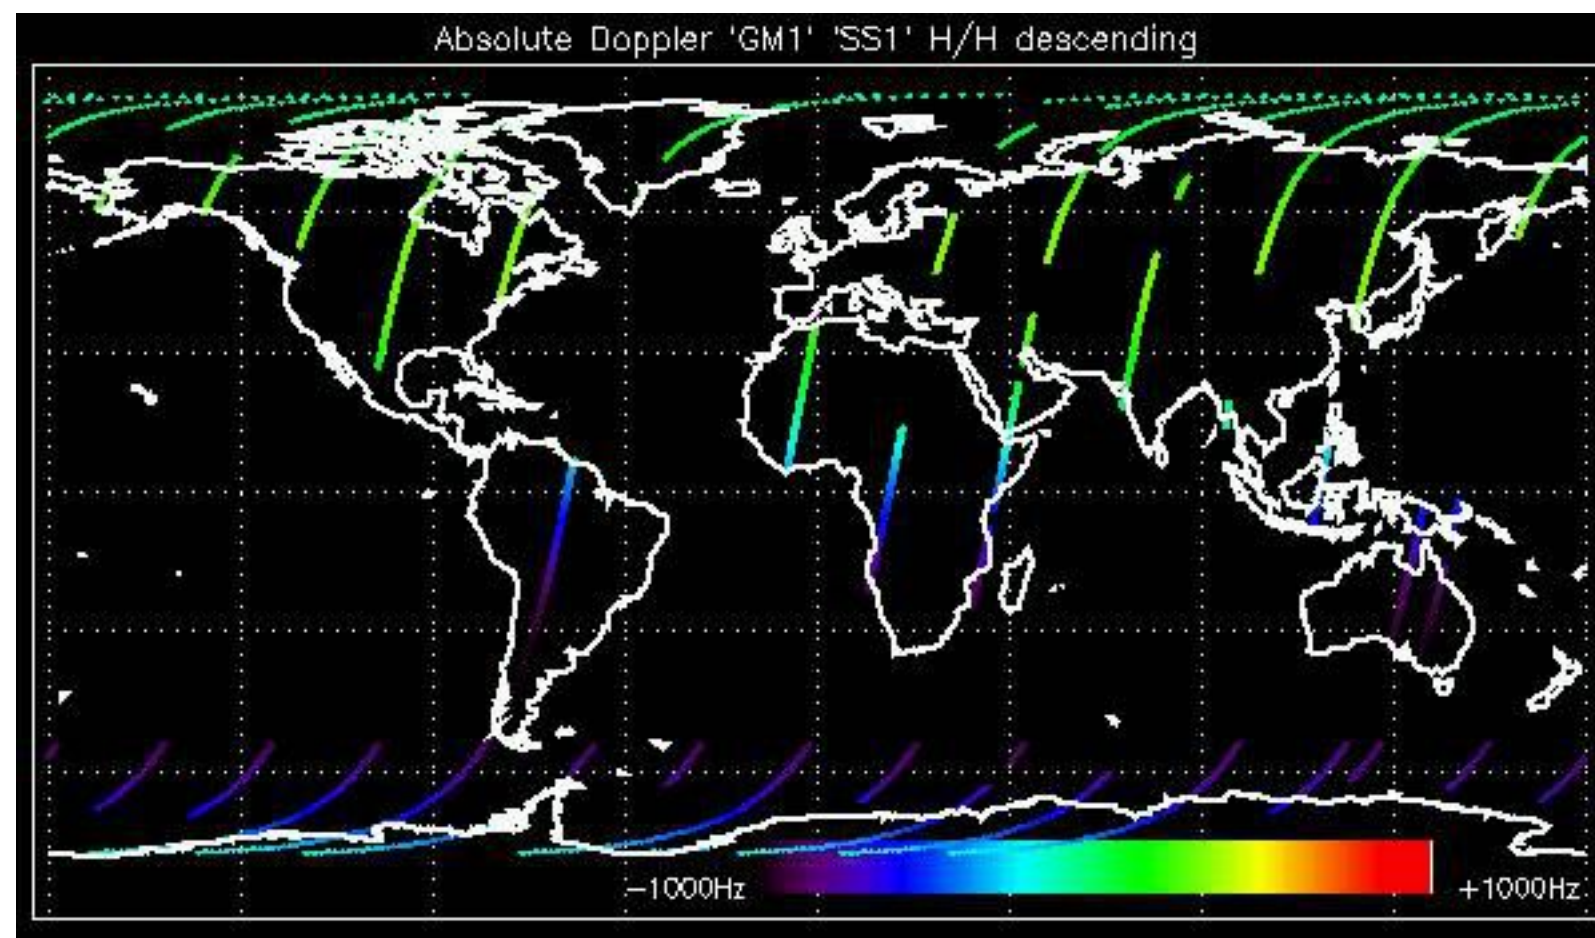


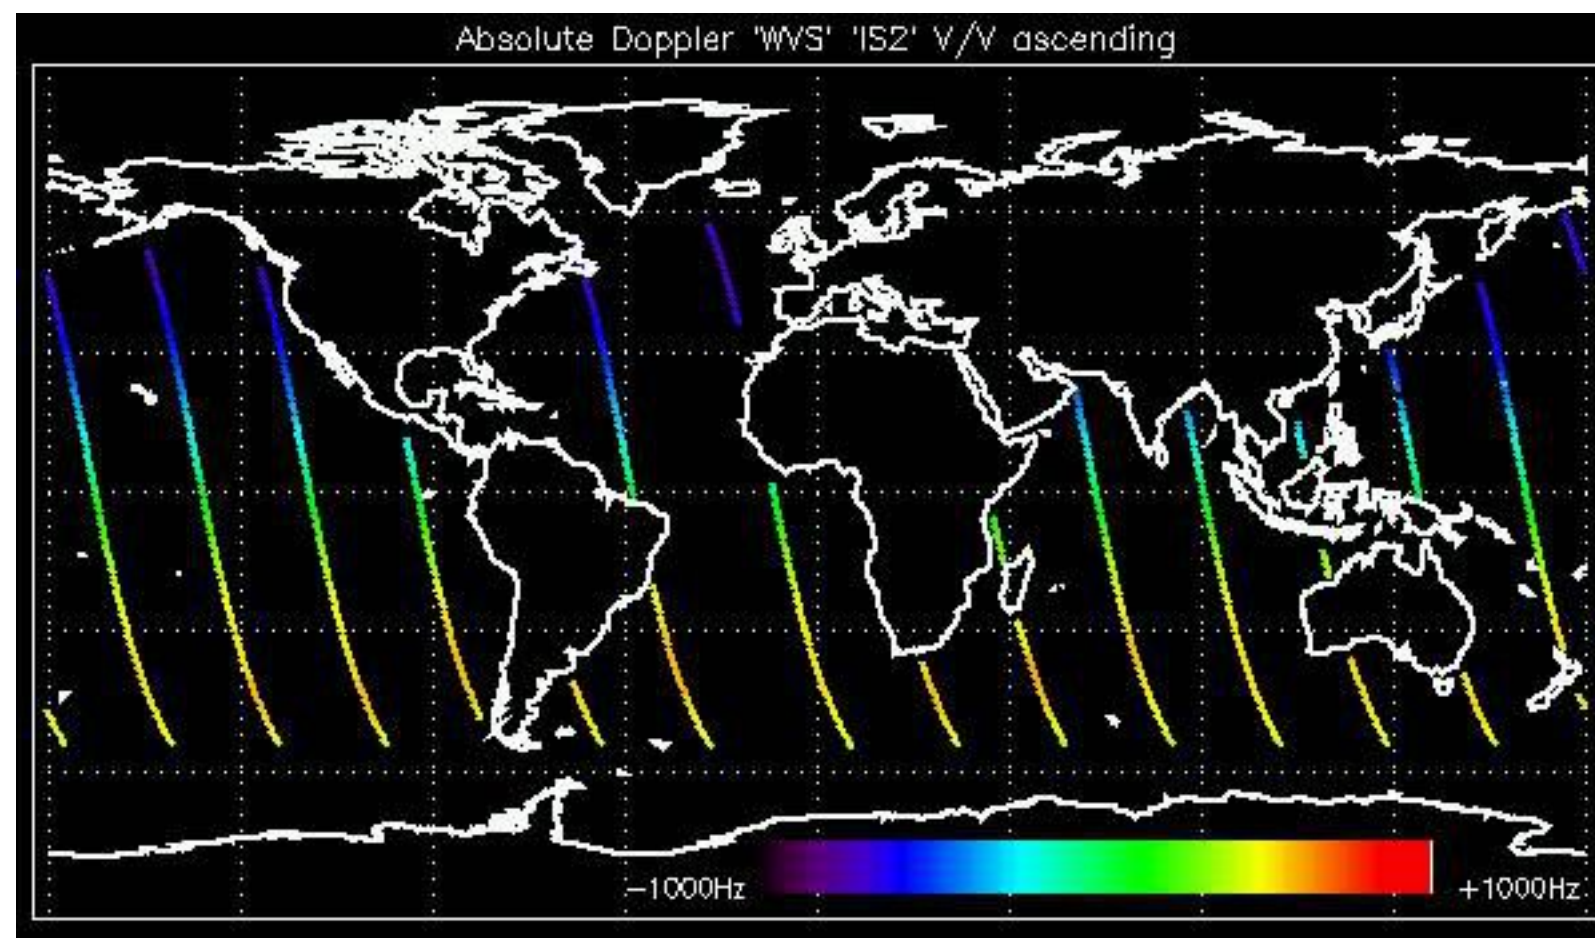


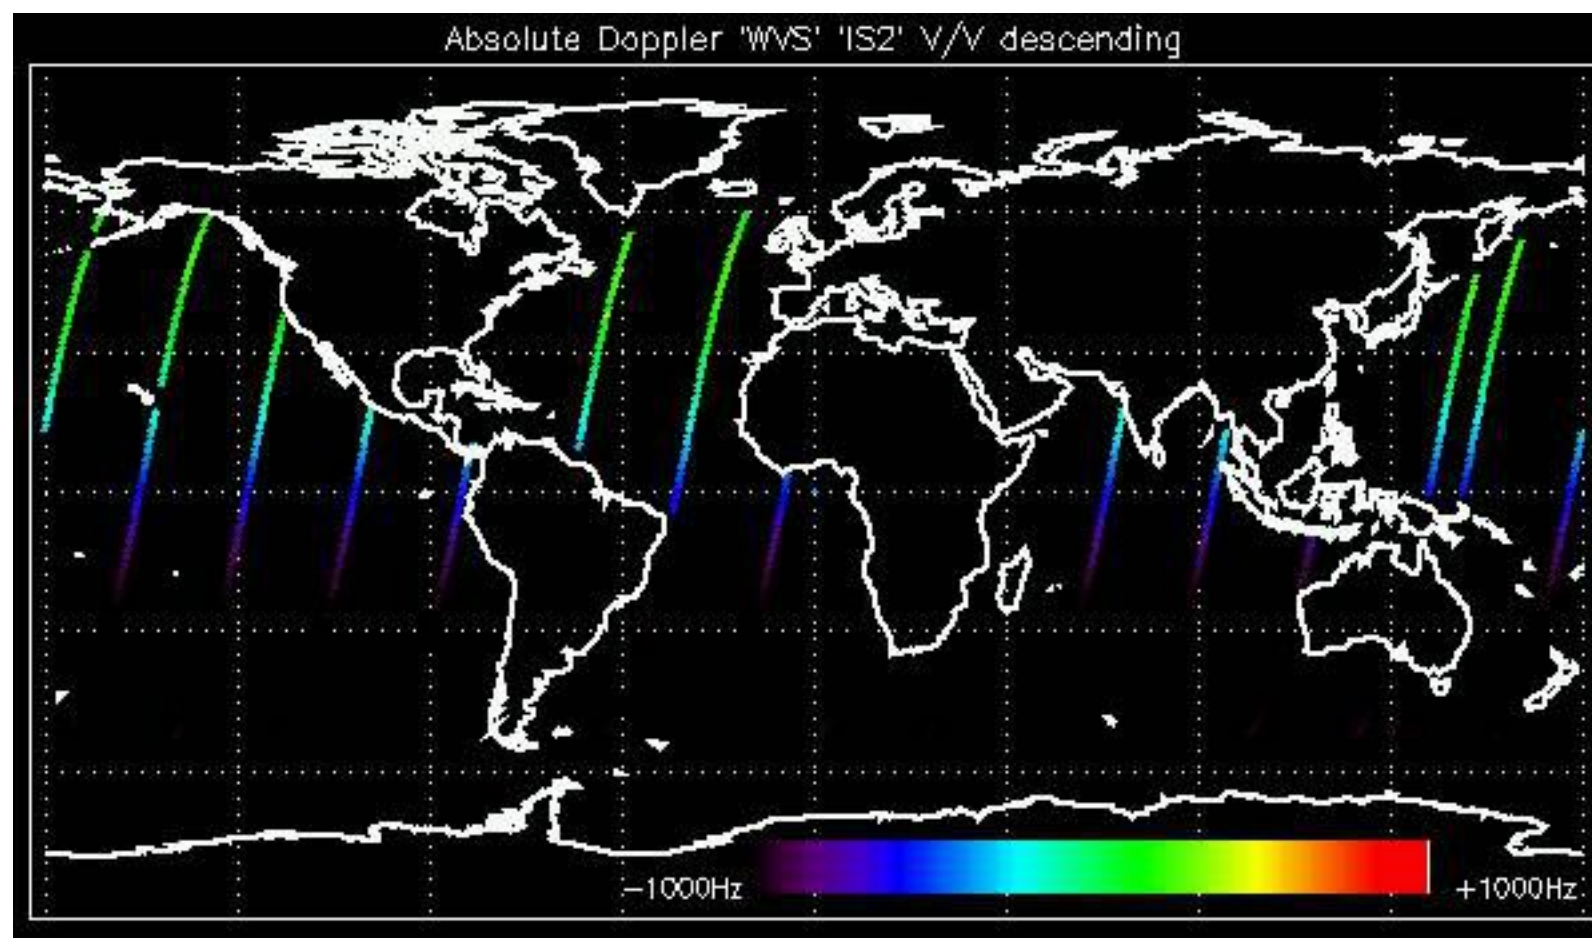


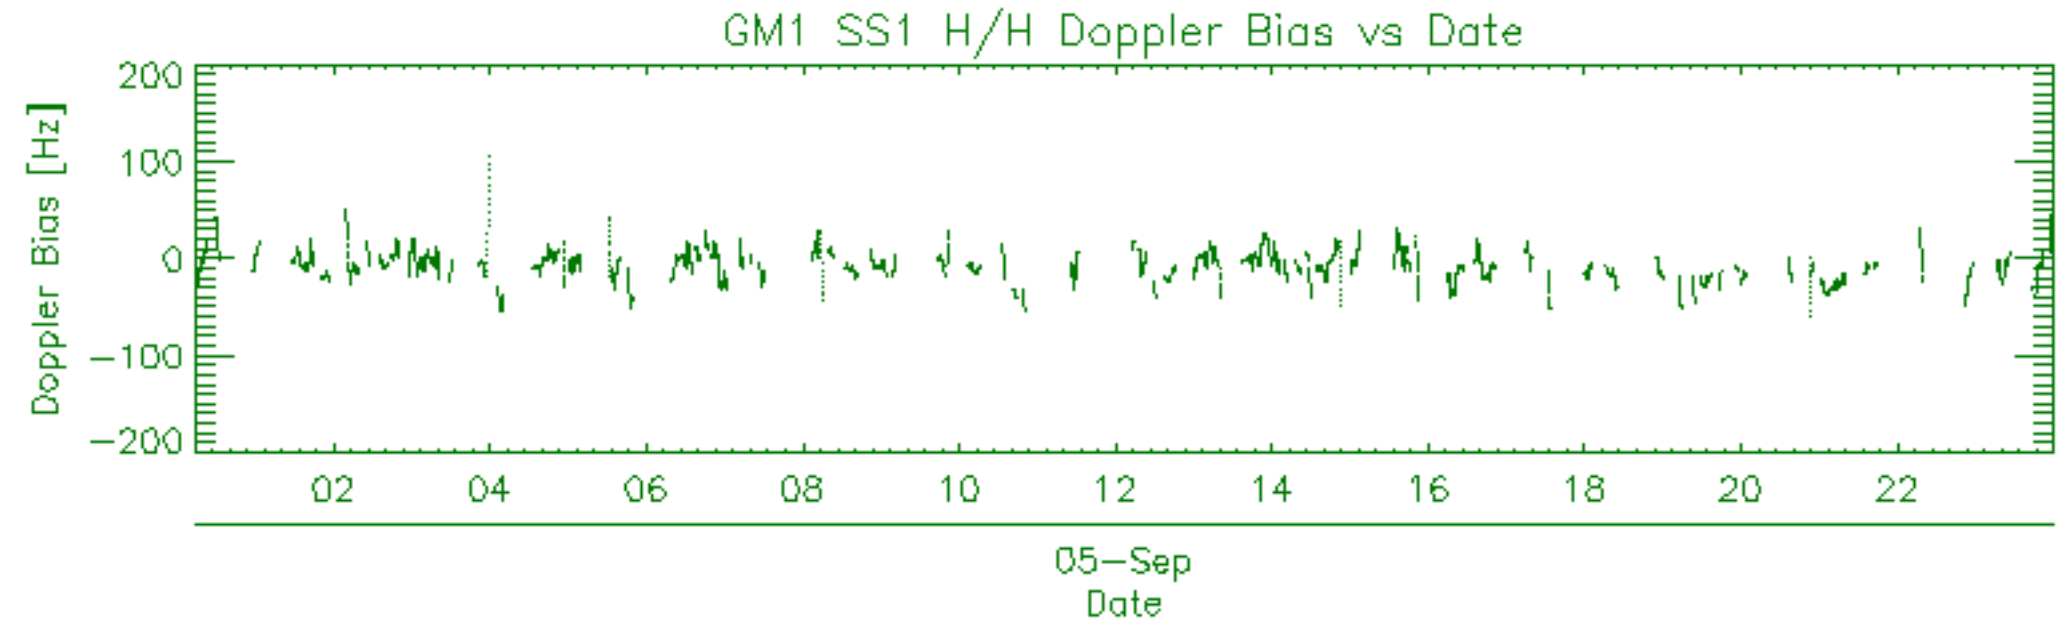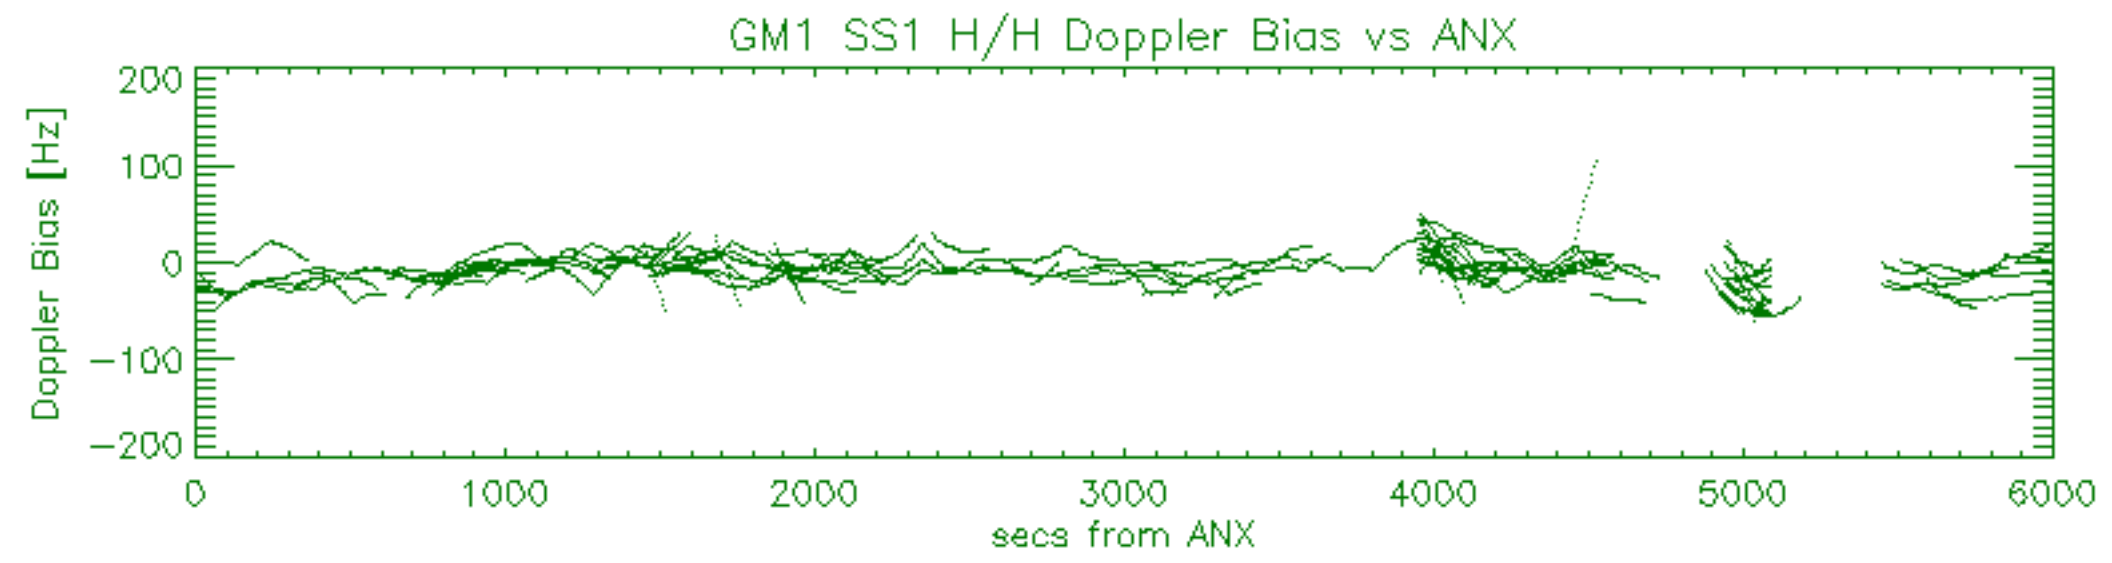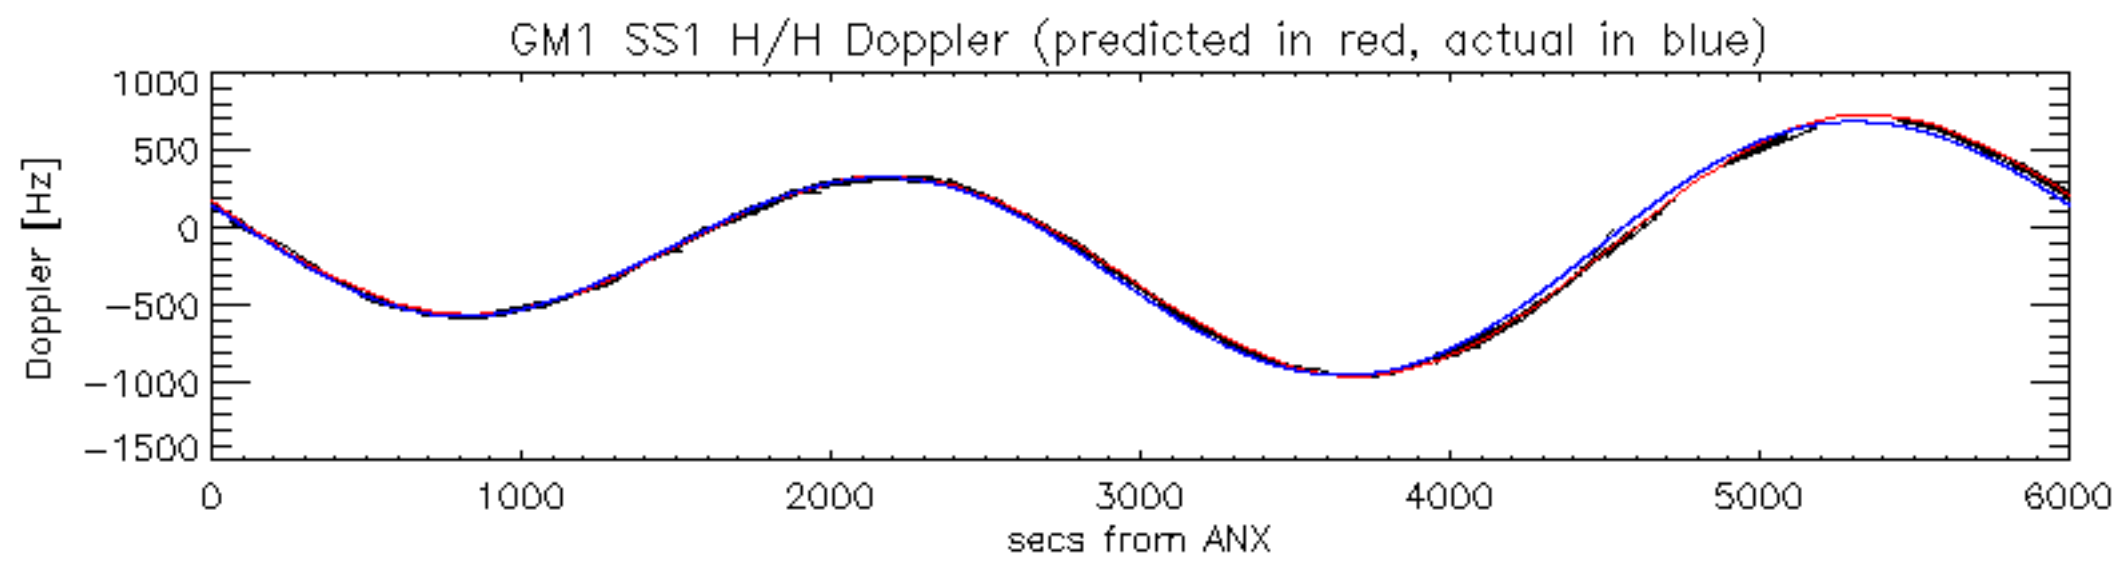




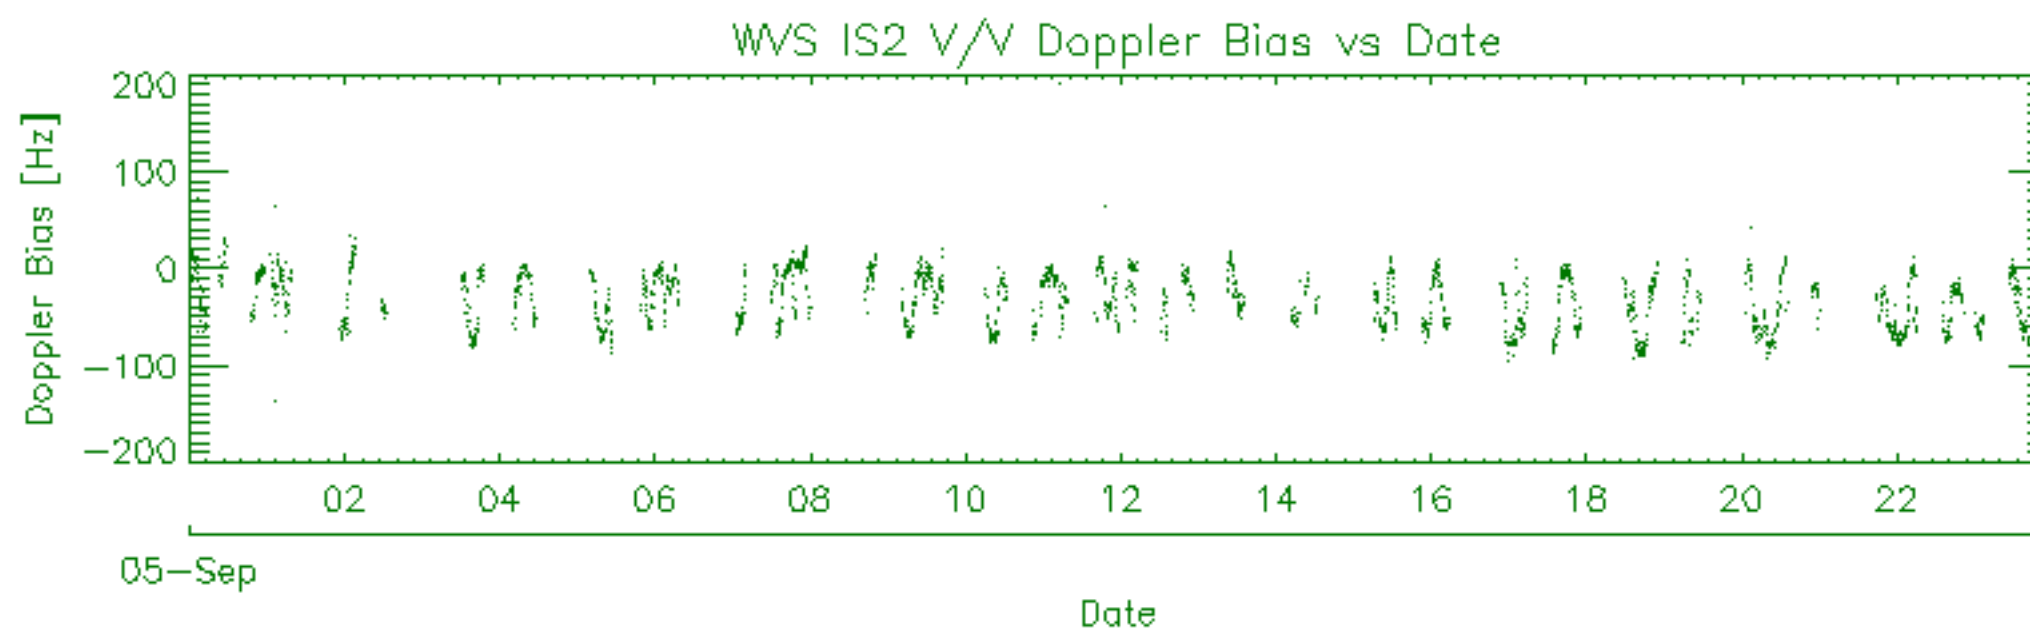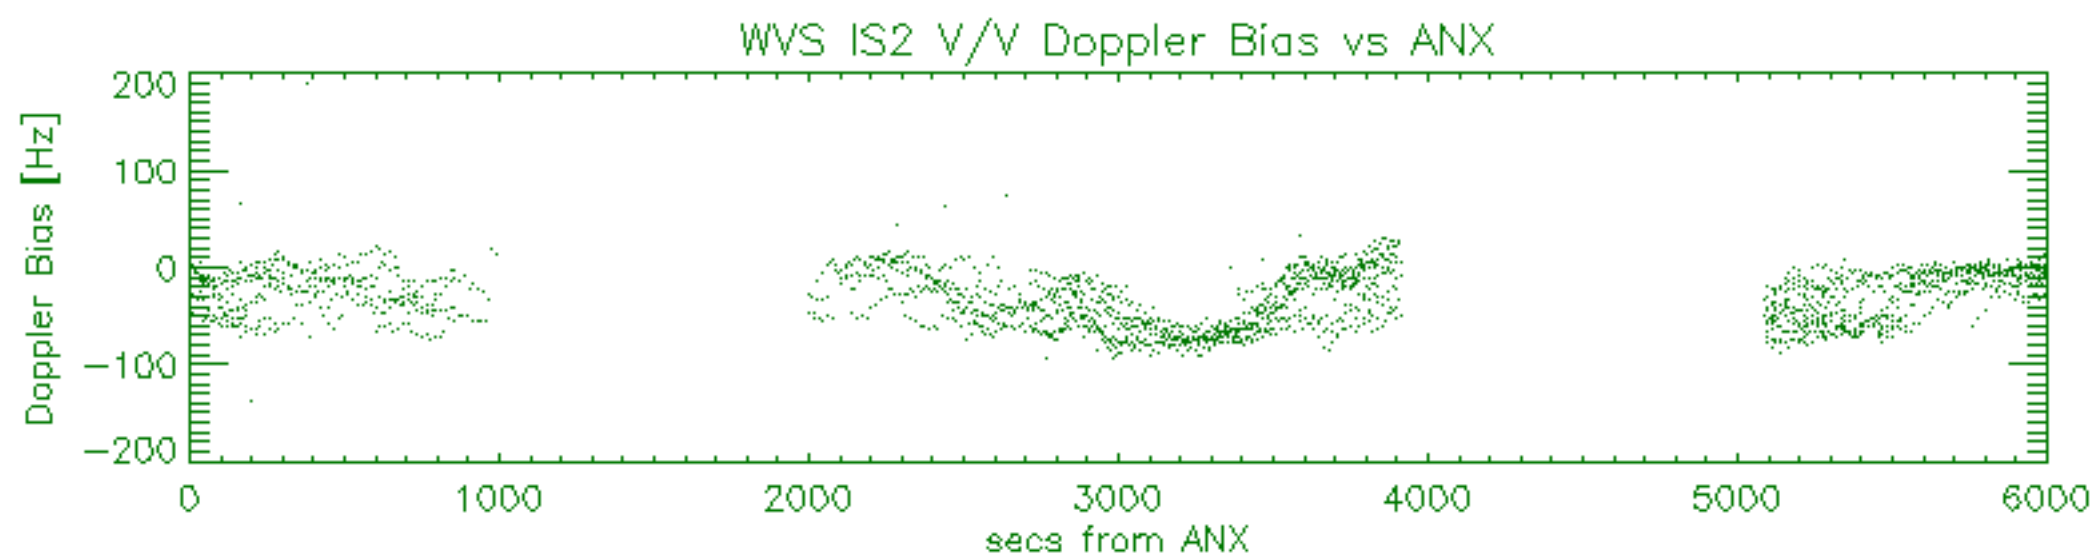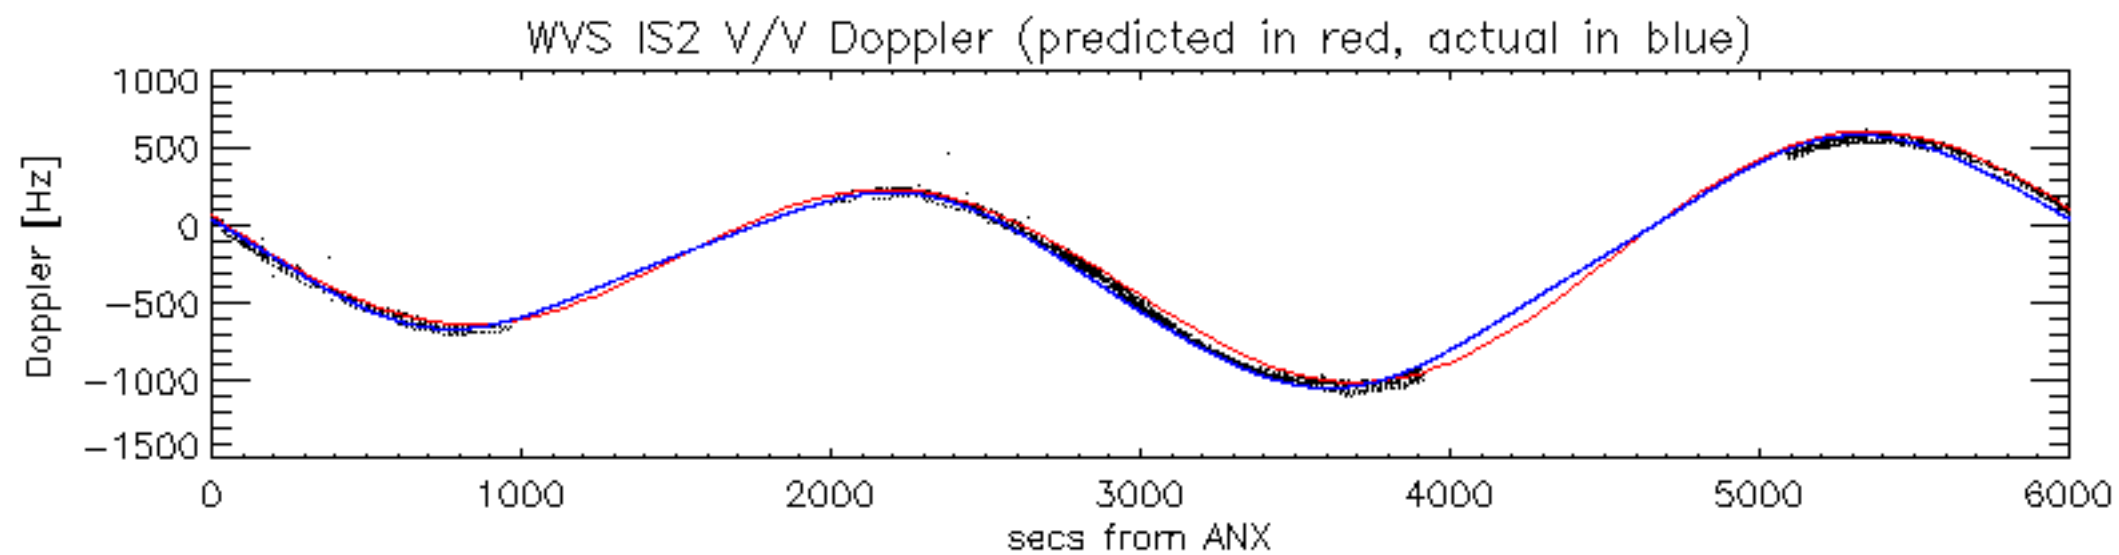

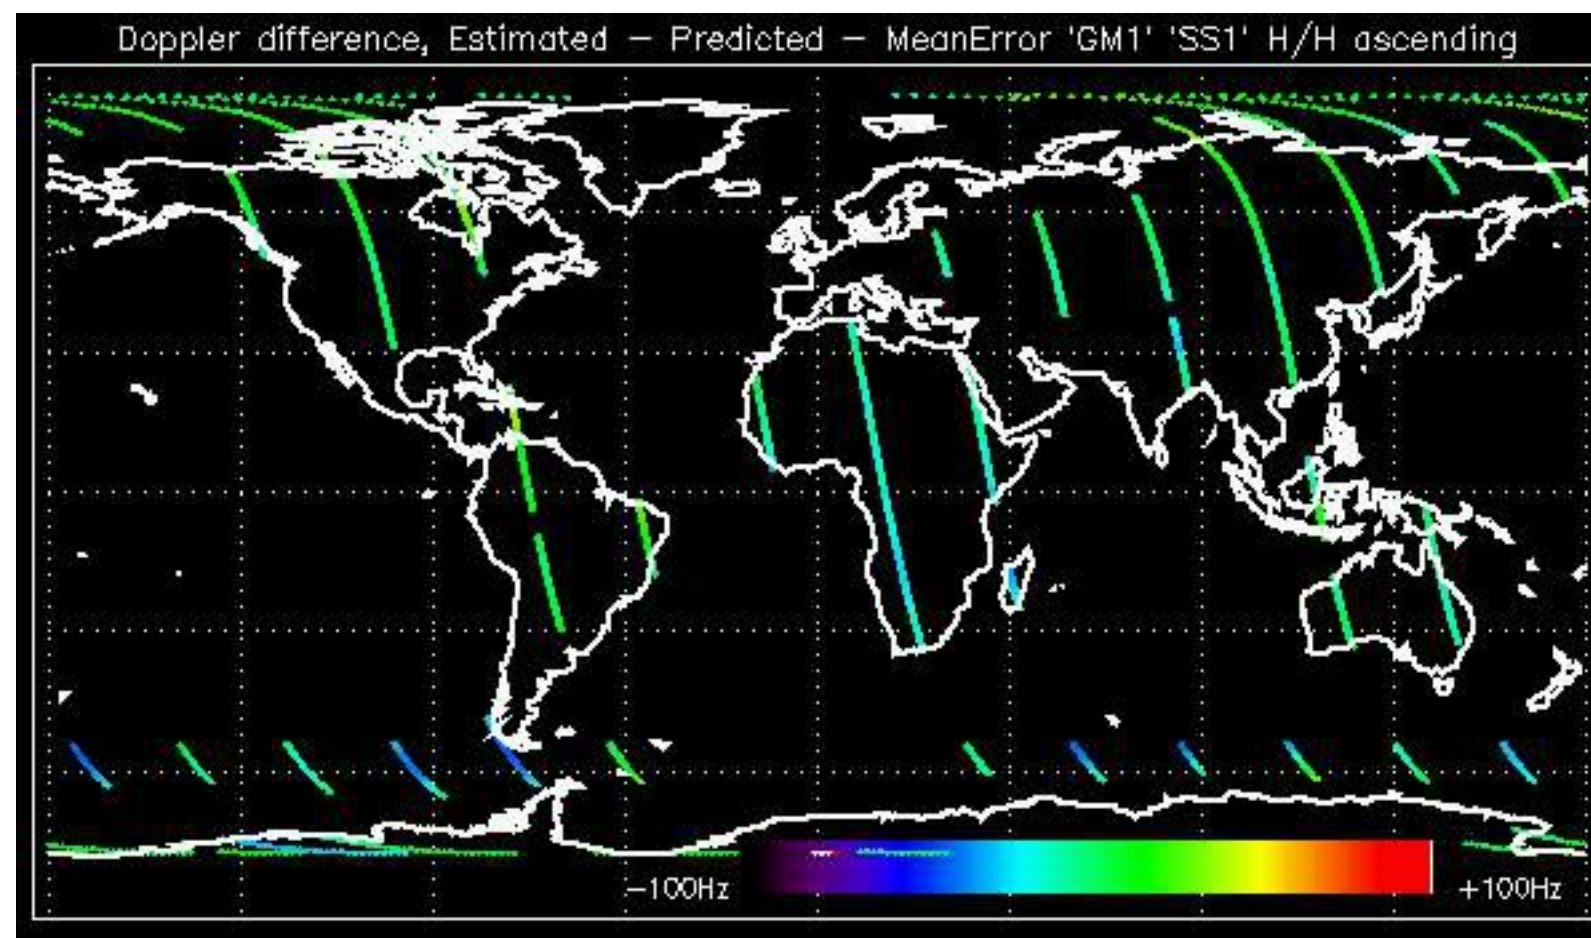





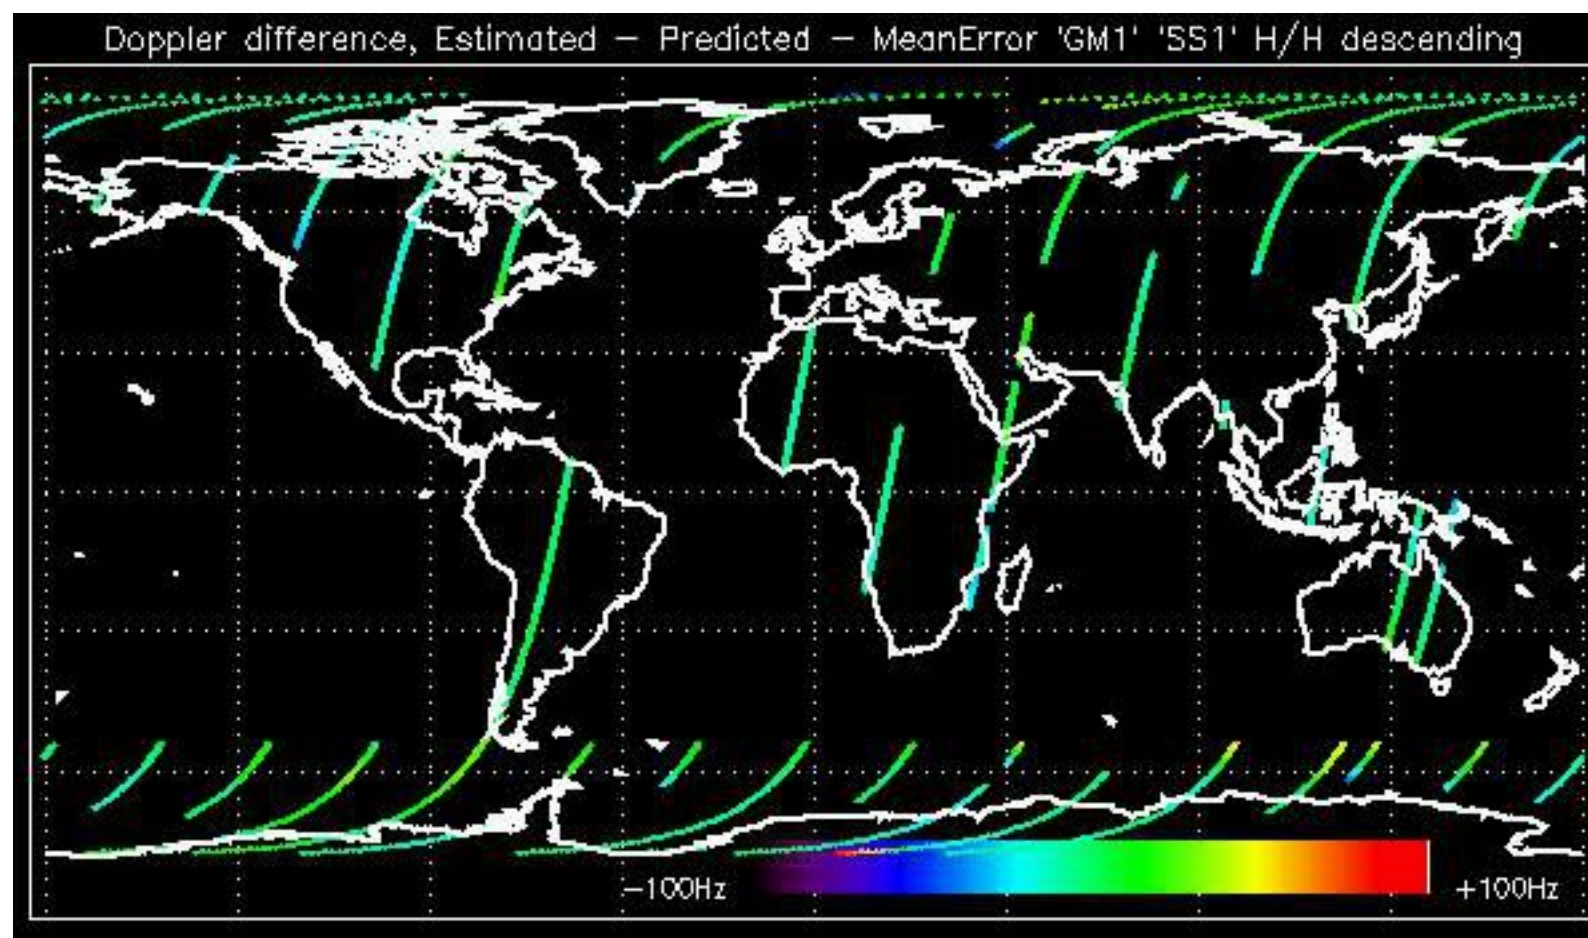








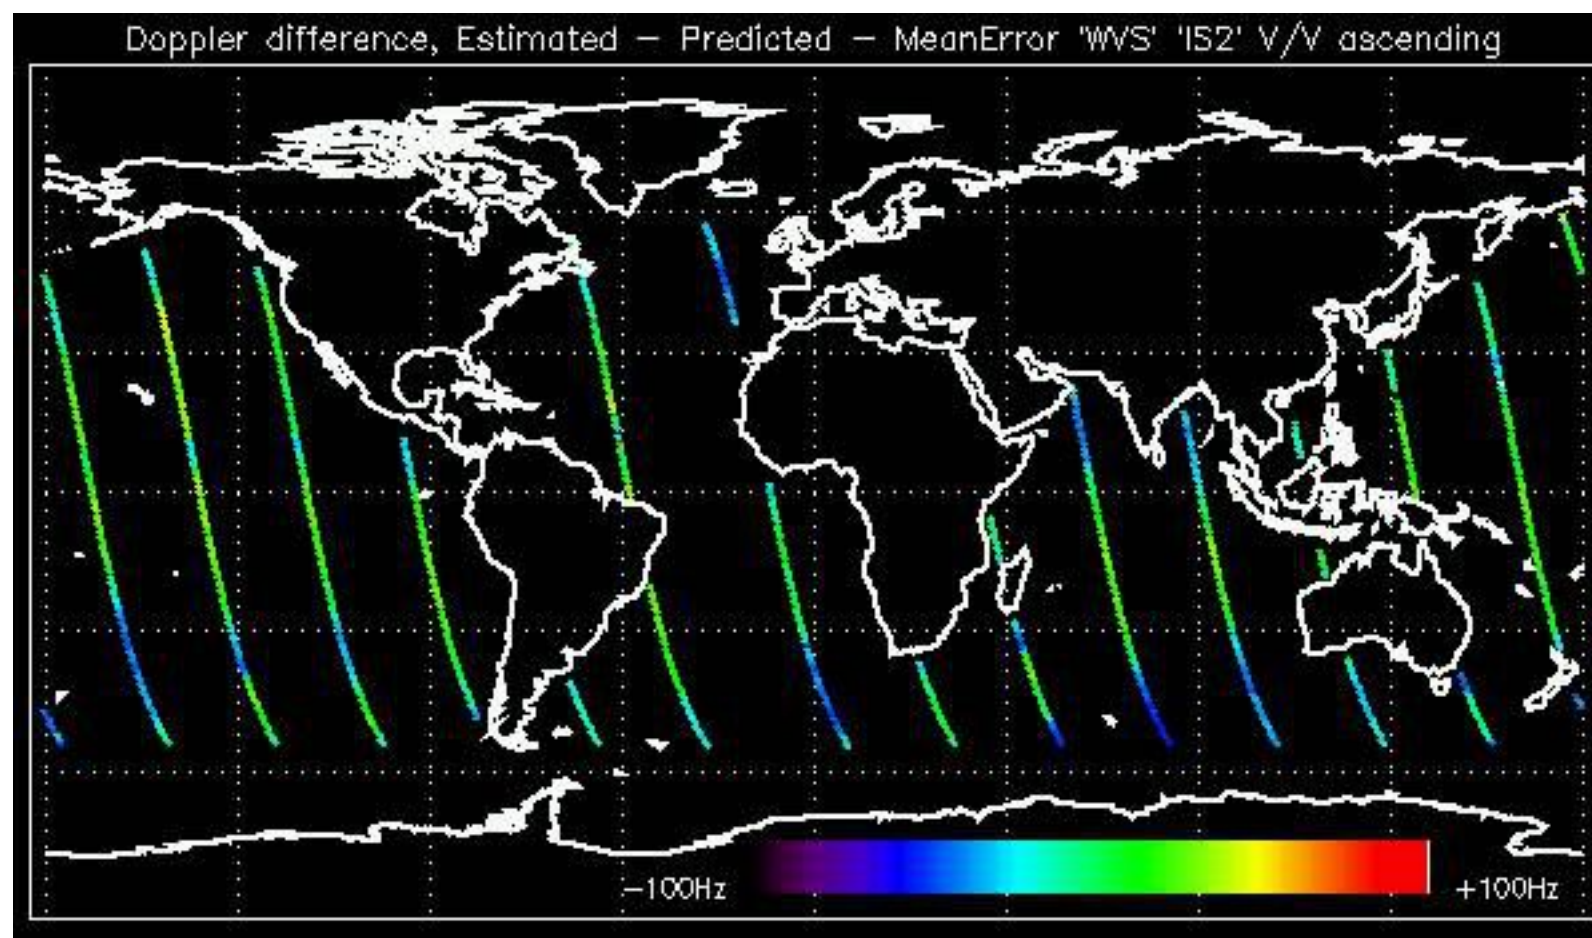



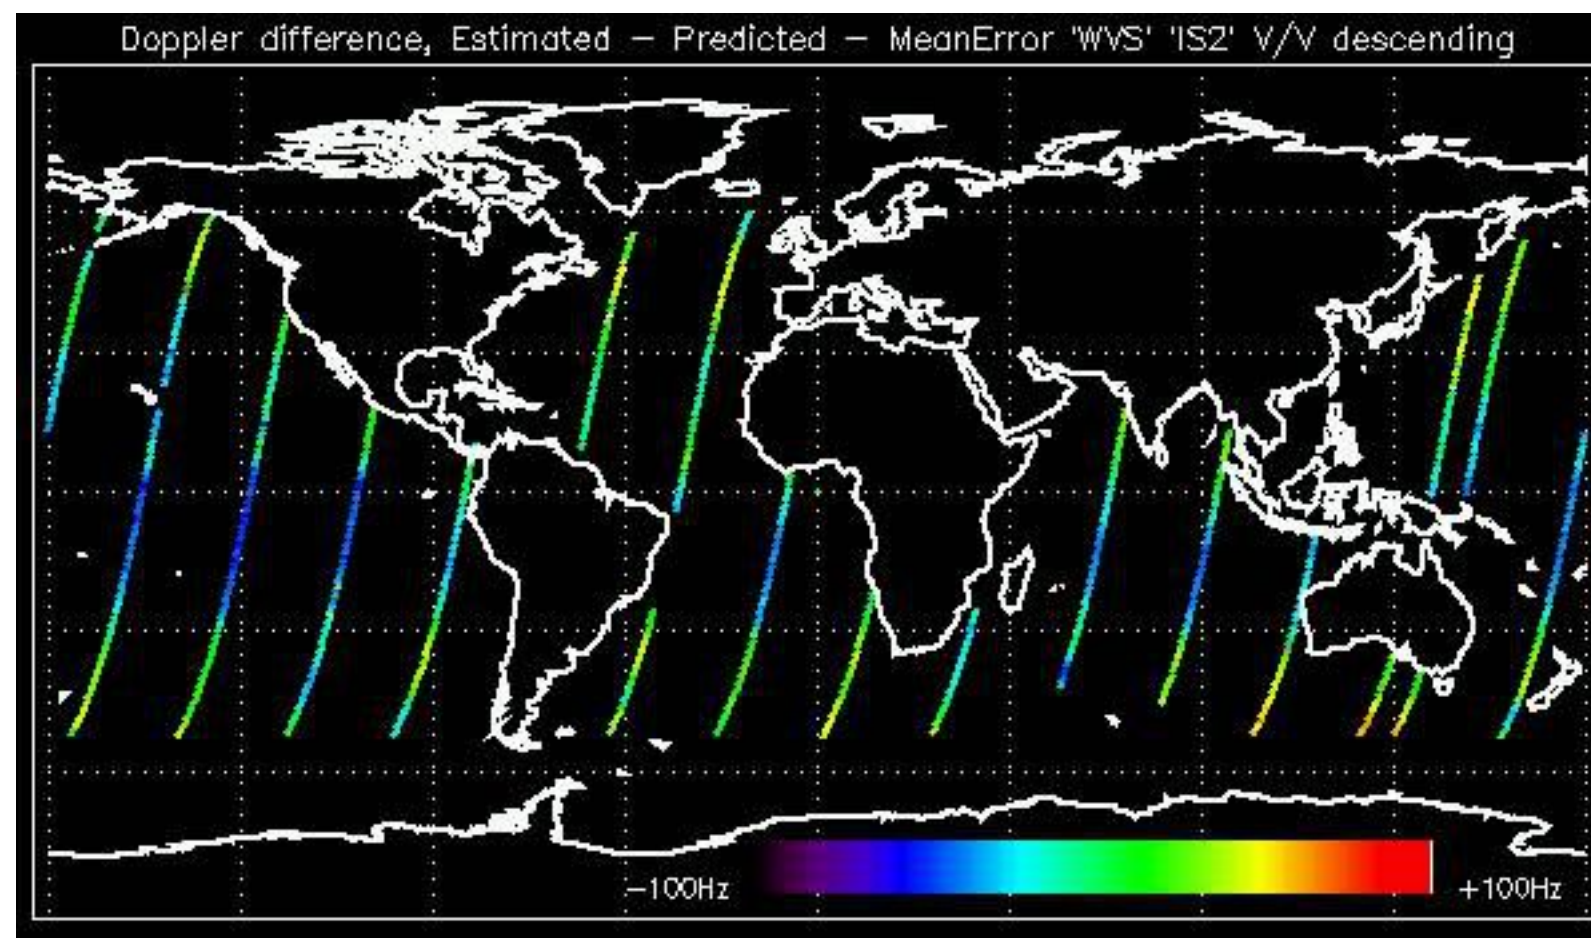

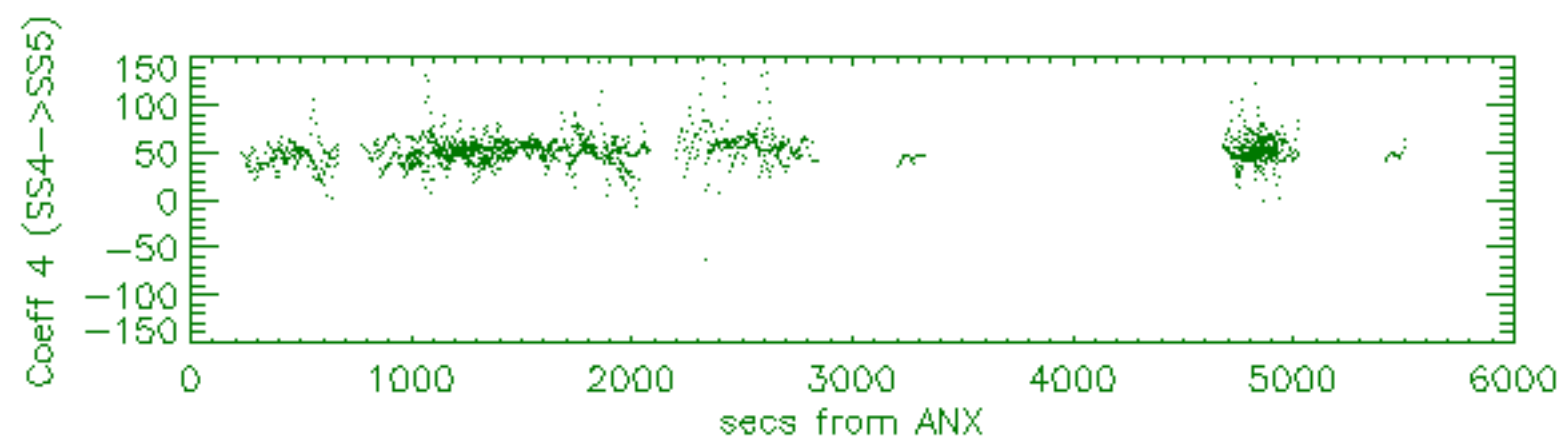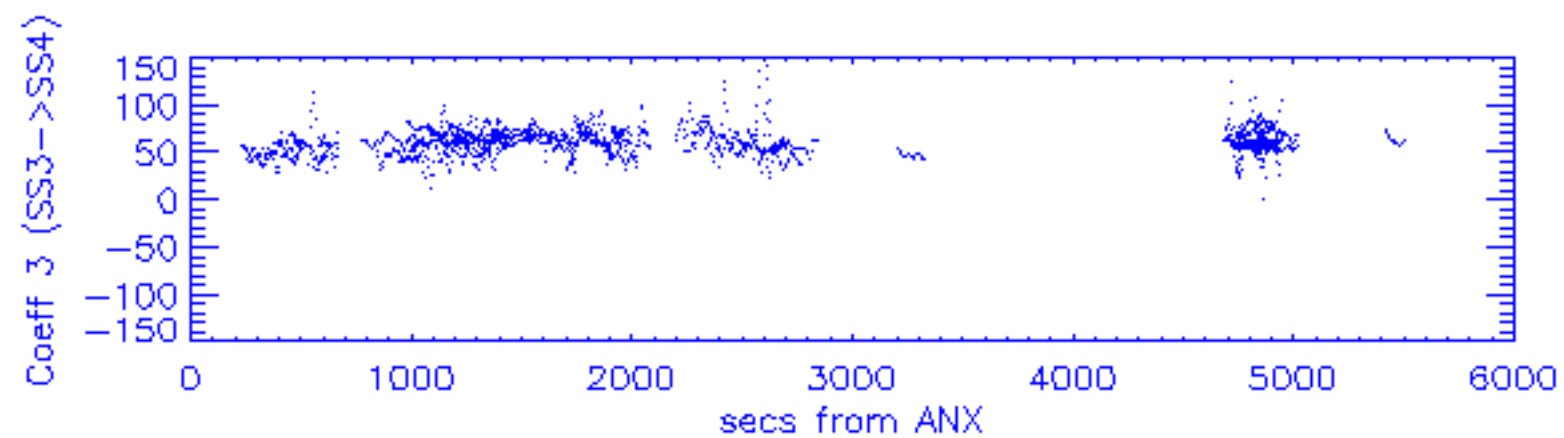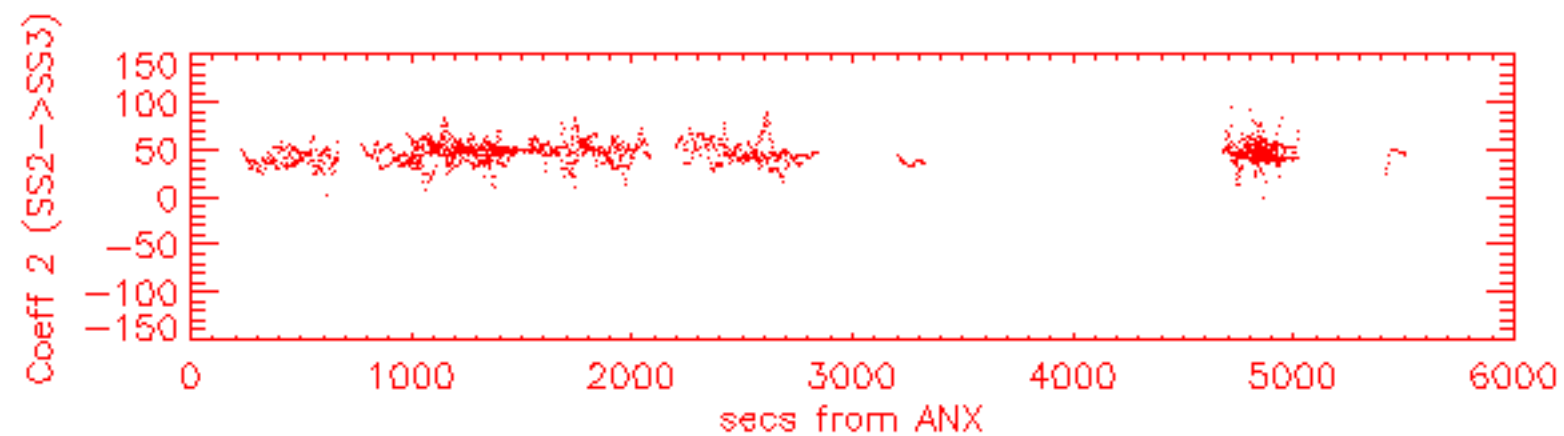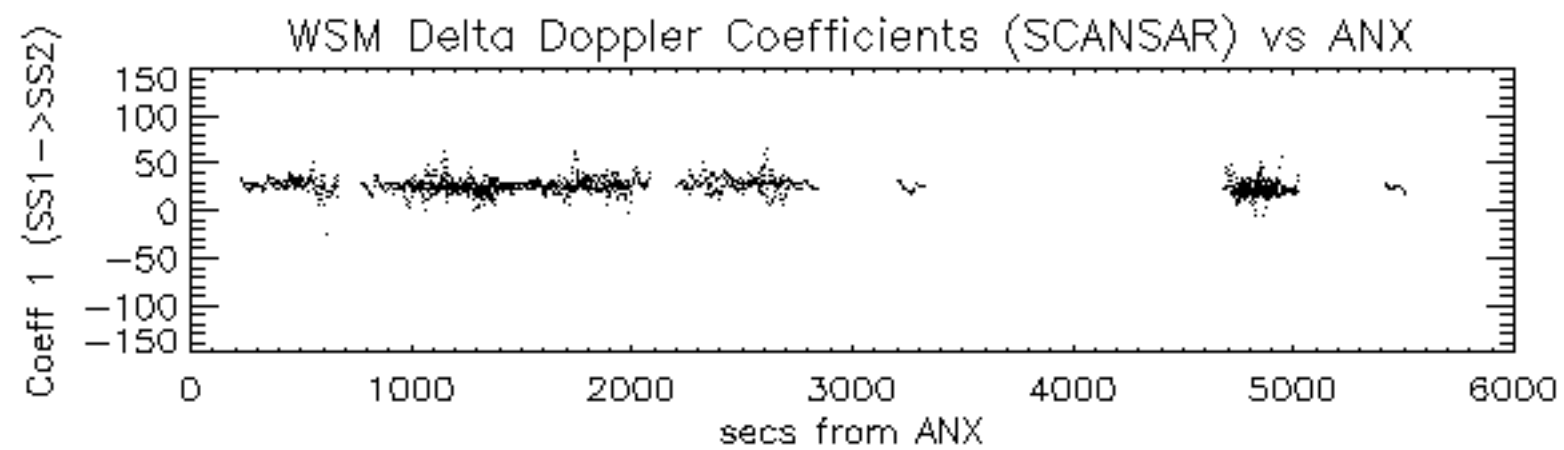

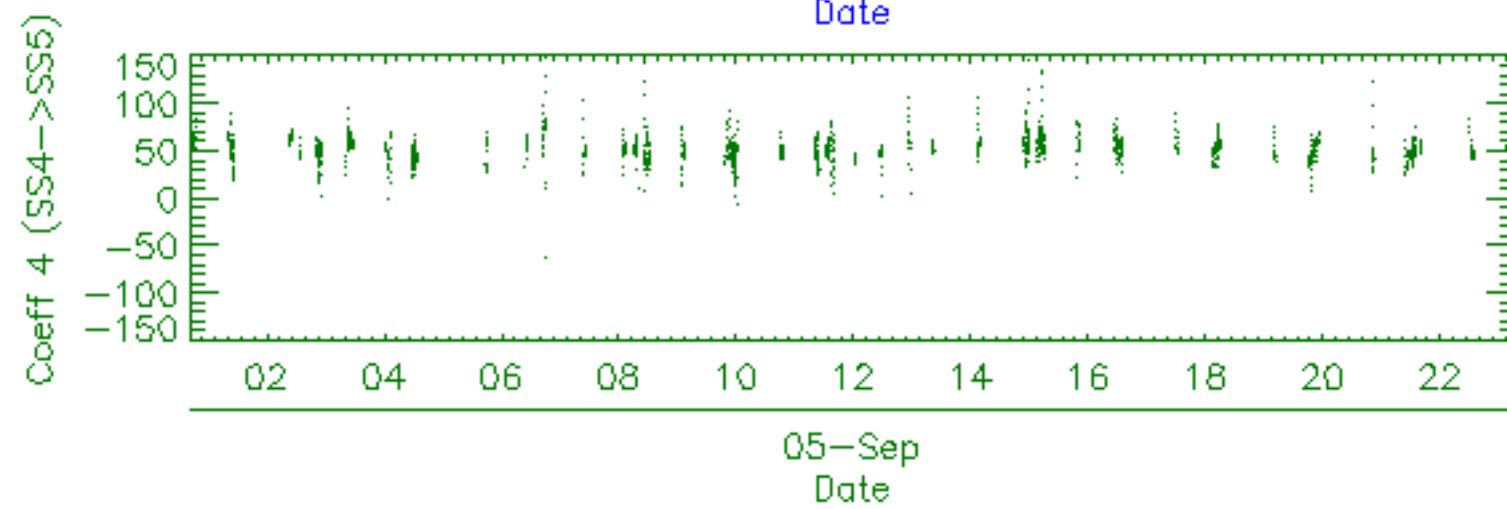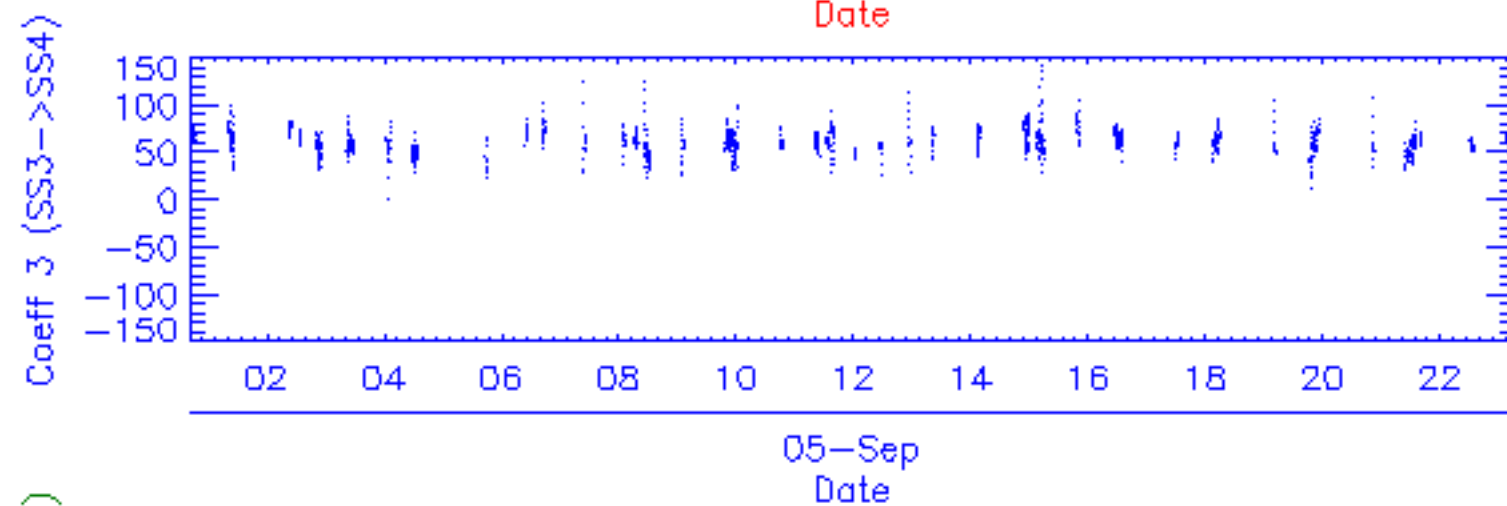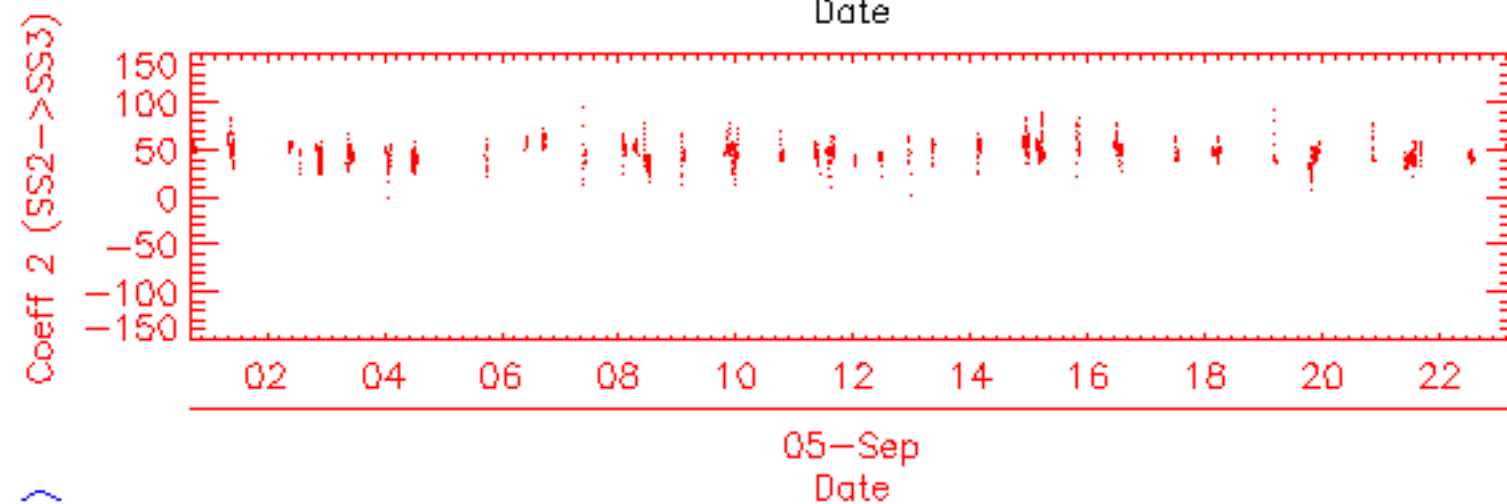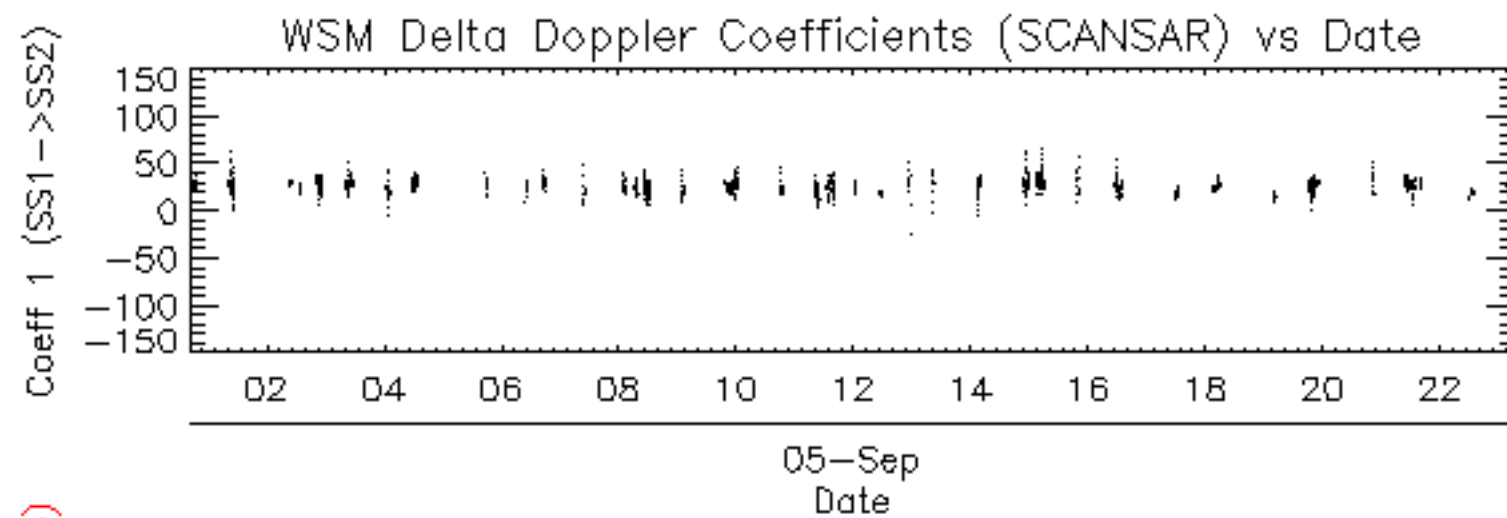
























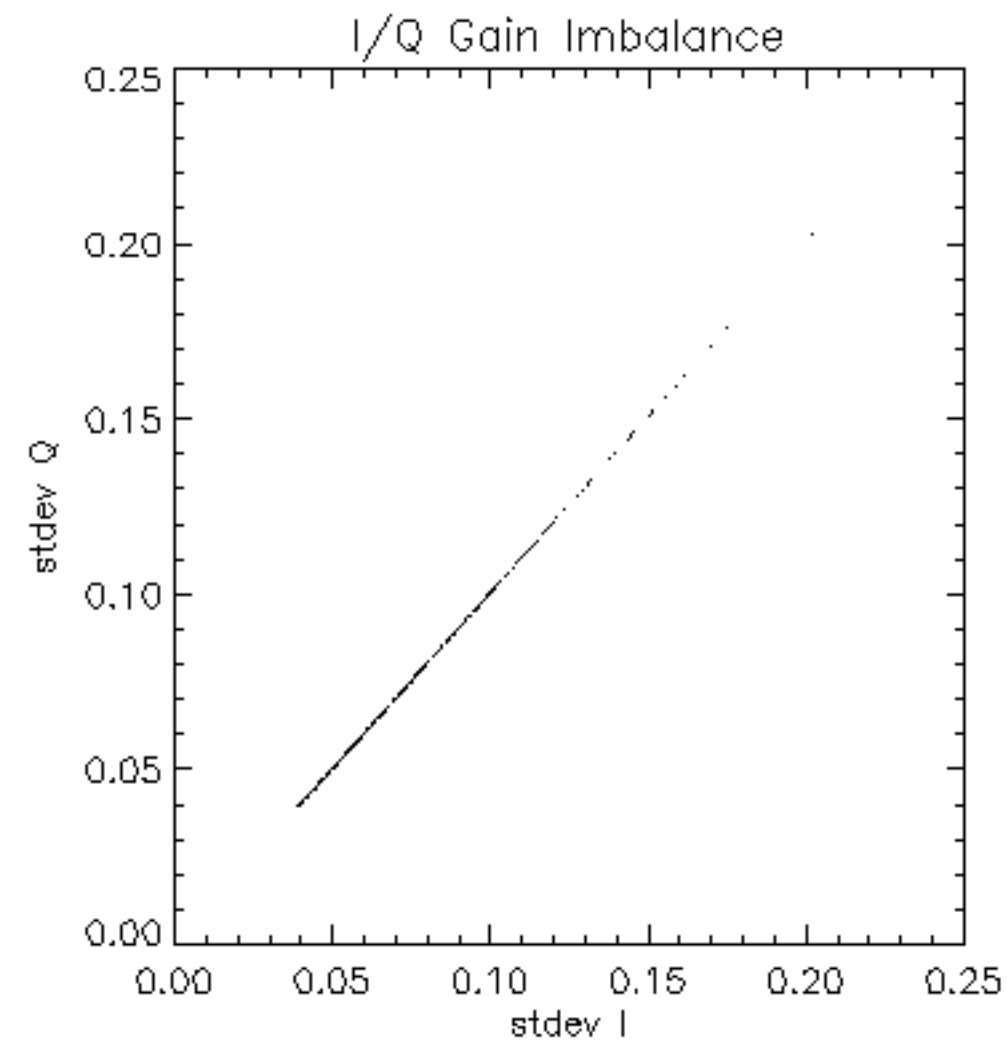




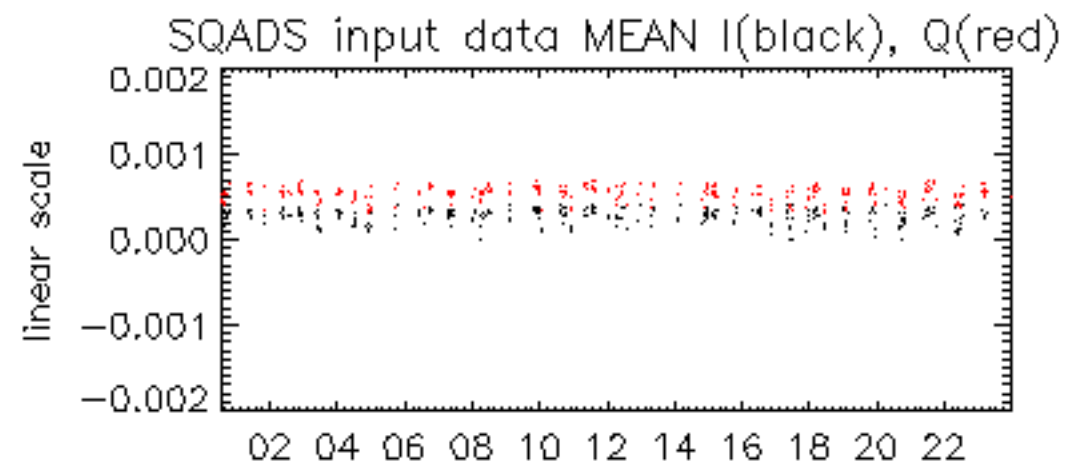


05-Sep

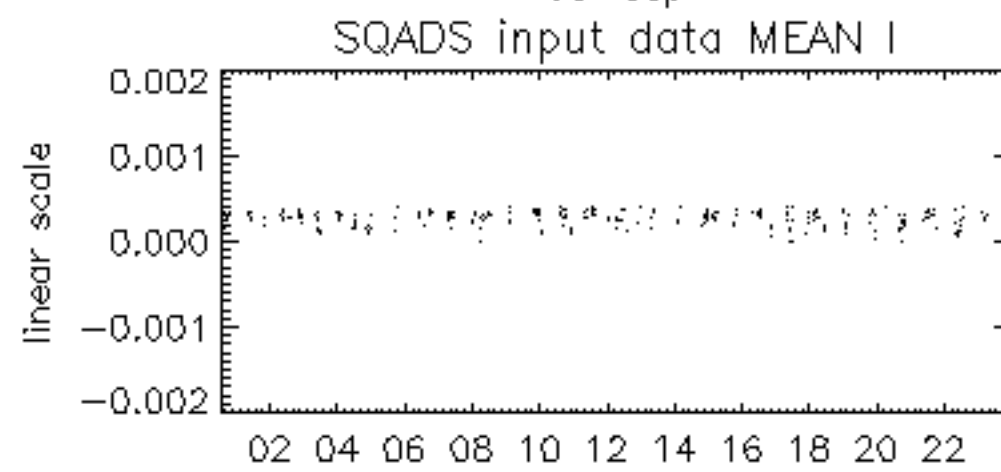


05-Sep

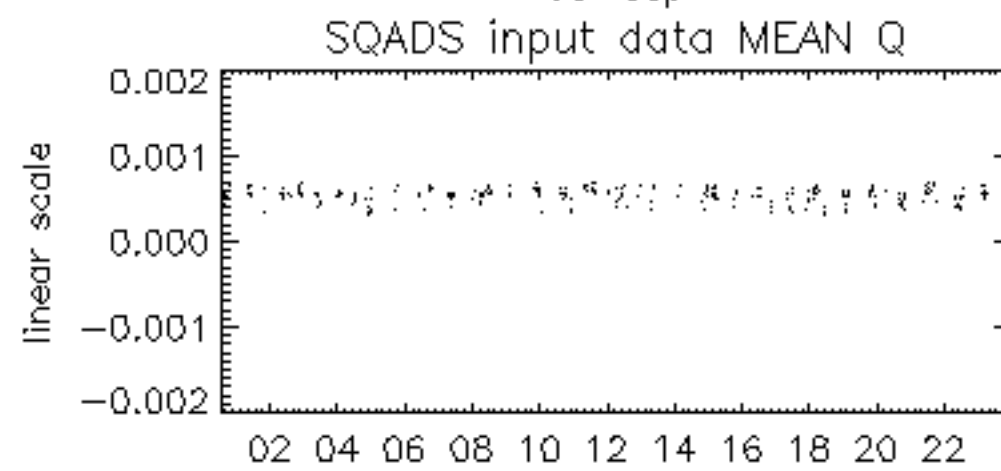


05-Sep

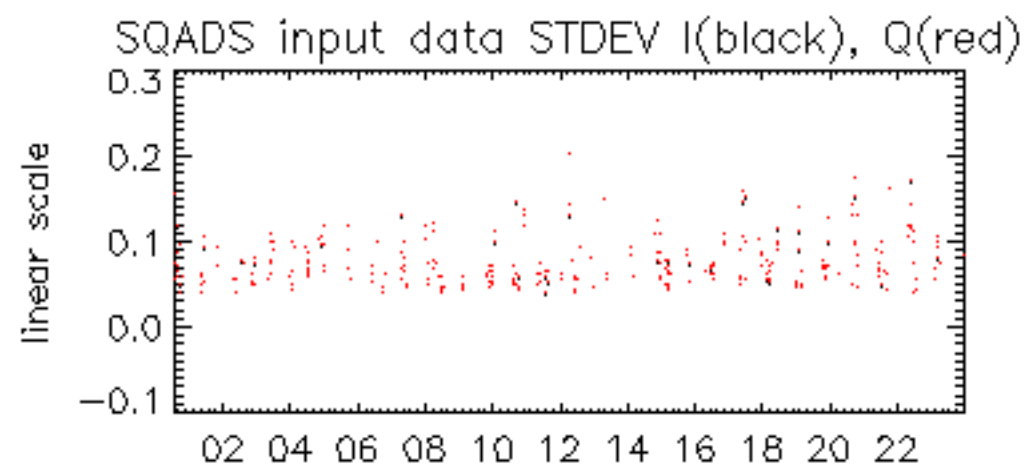

05-Sep

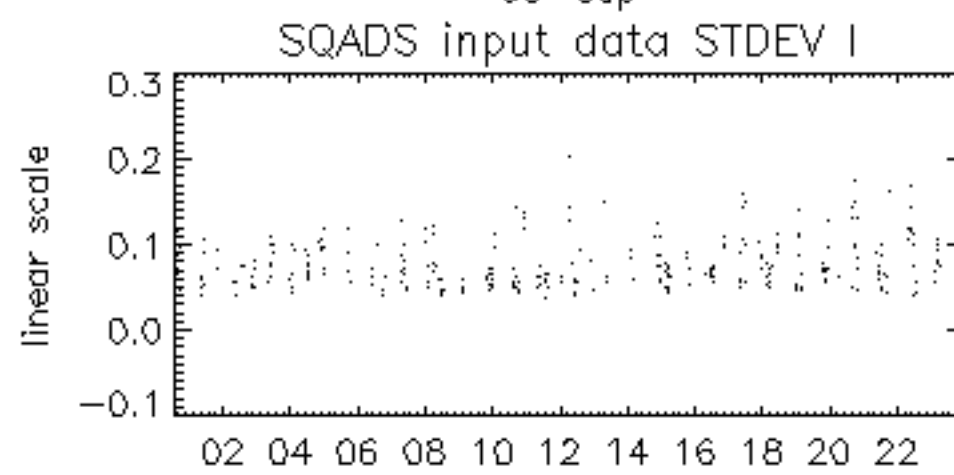

05-Sep

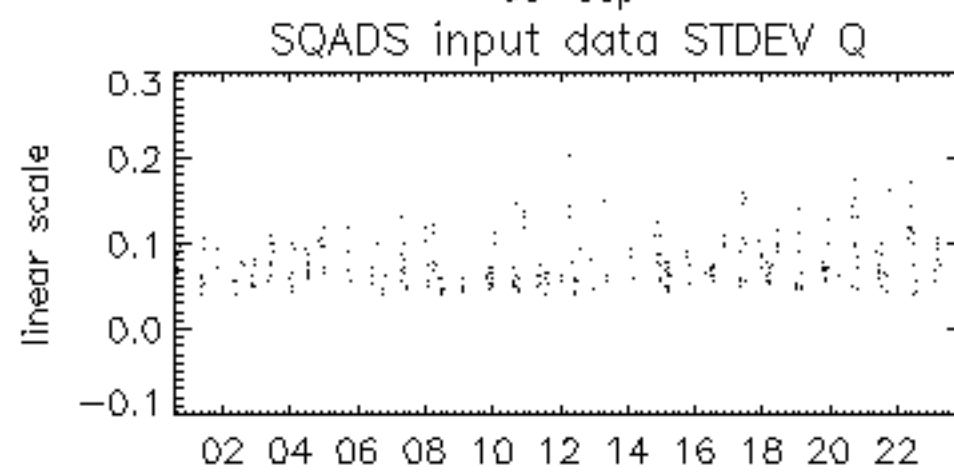

05-Sep

