



Analysis from 08-NOV-2010 00:00:00 to 08-NOV-2010 23:59:59. Page generated on 09-NOV-2010 07:32:17.  
View log file: ASAR\_Daily\_Report\_20101109\_0731.log. For any anomalies please contact emma.griffiths@vega.co.uk, kajal.haria@vega.co.uk.

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

## SUMMARY

1. DATA SUMMARY
  - 1.1 Summary tables
  - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
  - 2.1 IECF operational ADFs list
  - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
  - 3.1 V/V polarisation
  - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
  - 4.1 Analysis for WVS IS2 V/V
    - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
    - 4.1.2 All Rows Analysis for WVS IS2 V/V
  - 4.2 Analysis for GM1 SS3 H/H
    - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
    - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
  - 5.1 Analysis for WVS IS2 V/V
    - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
    - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
  - 5.2 Analysis for GM1 SS1 H/H
    - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
    - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
  - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
  - 6.1 Analysis for WSM SS1 H/H
    - 6.1.1 ScaleFactor
  - 6.2 Analysis for WSM SS1 V/V
    - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
  - 7.1 Analysis for WVS
  - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
  - 8.1 Number of Missing Lines
  - 8.2 Number of Gaps

---

## 1 - DATA SUMMARY

### 1.1 - Summary tables

[ [BACK TO MENU](#) ]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	2	PDE	WS	H/H	48	PDE	IS1	H/H	3	PDE	IS6	H/H	4	PDE	WS	H/H	21	PDE	2010-11-08 00:42:01	V	320
PDE	IS2	V/V	22	PDK	WS	H/H	55	PDE	IS4	V/H	3	PDE	IS7	V/V	1	PDE	WS	V/V	8	PDE	2010-11-08 05:42:43	H	320
PDK	IS2	V/V	23									PDK	IS6	H/H	1	PDK	WS	H/H	16	PDE	2010-11-08 20:44:49	V	320
												PDK	IS7	V/V	1	PDK	WS	V/V	1	PDK	2010-11-08 10:43:25	V	320
																				PDK	2010-11-08 15:44:07	H	320

## 1.2 - Lists of products used

[ [BACK TO MENU](#) ]

[TXT] [XLS] [List\\_WVS\\_products\\_used](#)  
 [TXT] [XLS] [List\\_GM1\\_products\\_used](#)  
 [TXT] [XLS] [List\\_APM\\_products\\_used](#)  
 [TXT] [XLS] [List\\_IMM\\_products\\_used](#)  
 [TXT] [XLS] [List\\_WSM\\_products\\_used](#)  
 [TXT] [XLS] [List\\_MS\\_products\\_used](#)

## 2 - AUXILIARY FILES ANALYSIS

### 2.1 - IECF operational ADFs list

[ [BACK TO MENU](#) ]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20100608_125449_20100317_120410_20101231_000000
ASA_INS_AXVIEC20101028_095209_20101022_000000_20101231_235959
ASA_XCH_AXVIEC20091217_113006_20020301_000000_20101231_000000
ASA_XCA_AXVIEC20100608_123419_20100317_120410_20110101_000000

### 2.2 - Products with wrong ADFs

[ [BACK TO MENU](#) ]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0


[TXT] [XLS] [Check\\_ADFs\\_WVS](#)  
 [TXT] [XLS] [Check\\_ADFs\\_GM1](#)  
 [TXT] [XLS] [Check\\_ADFs\\_APM](#)  
 [TXT] [XLS] [Check\\_ADFs\\_IMM](#)  
 [TXT] [XLS] [Check\\_ADFs\\_WSM](#)

## 3 - MODULE STEPPING PRODUCTS ANALYSIS

SECOND FIXED REFERENCE

Pre-launch reference (2001-02-09)


Reference: 2001-02-09 14:08:23 V RxGain  
 Test : 2010-11-08 20:44:49 V

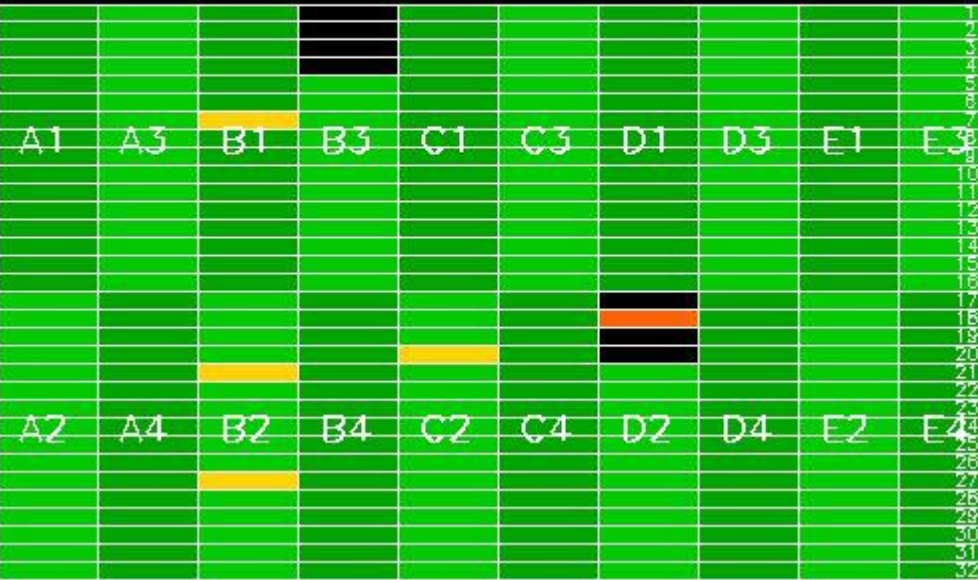

PREVIOUS PRODUCT REFERENCE

Previous product in the same polarisation


Reference: 2010-11-08 10:43:25 V RxGain  
 Test : 2010-11-08 20:44:49 V




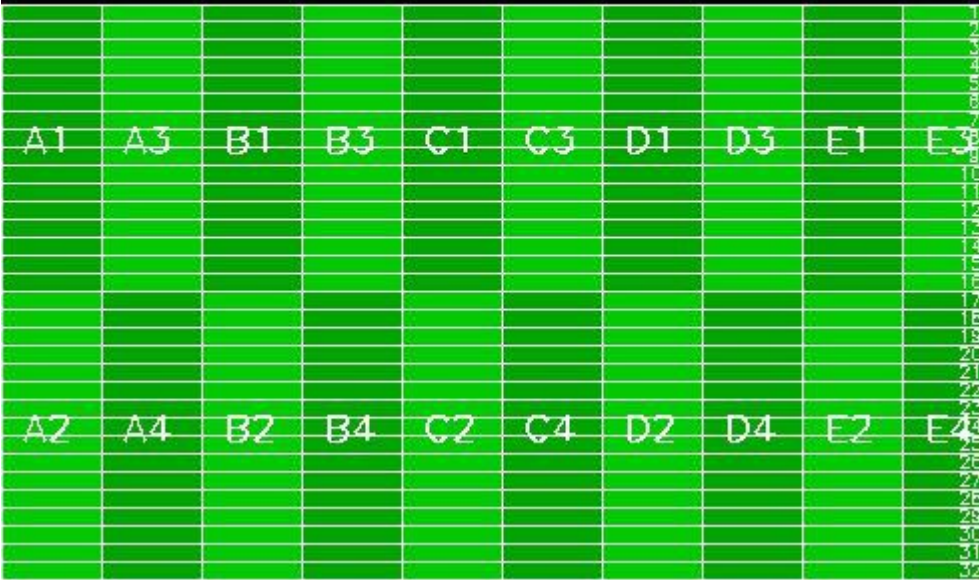


Reference: 2001-02-09 14:08:23 V RxPhase  
 Test : 2010-11-08 20:44:49 V



Reference: 2010-11-08 10:43:25 V RxPhase  
 Test : 2010-11-08 20:44:49 V

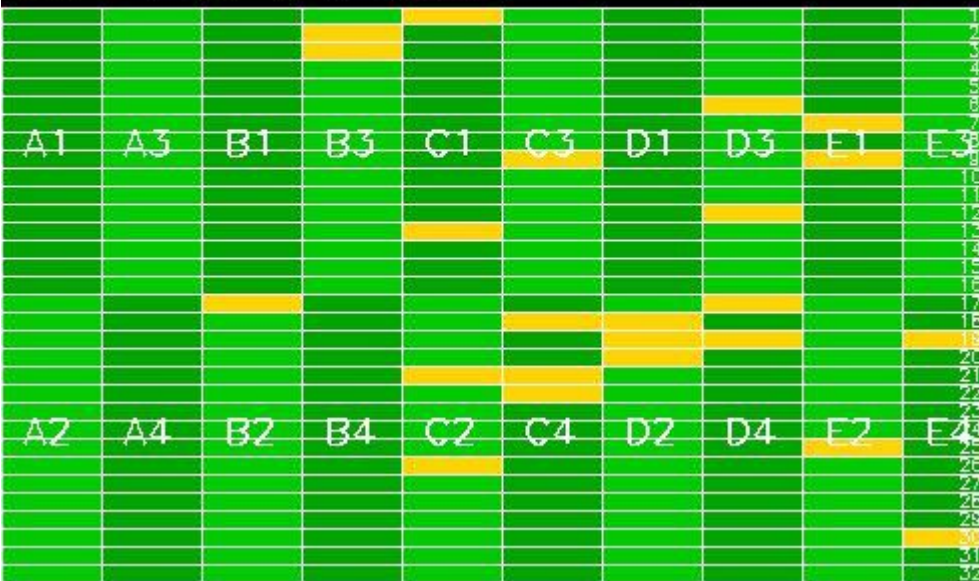

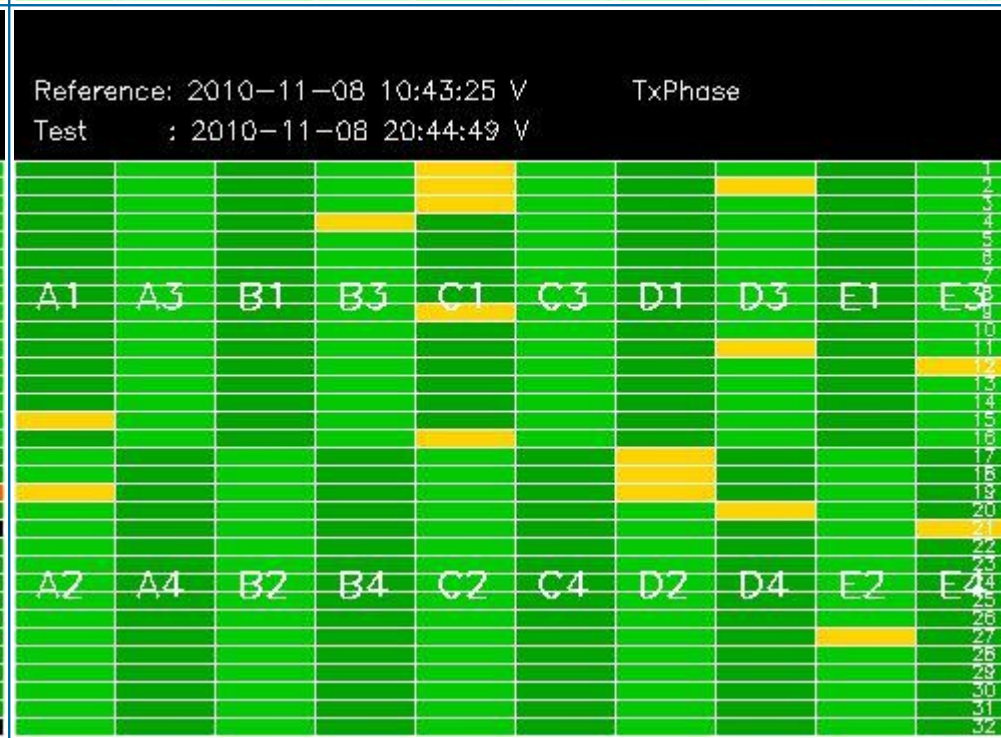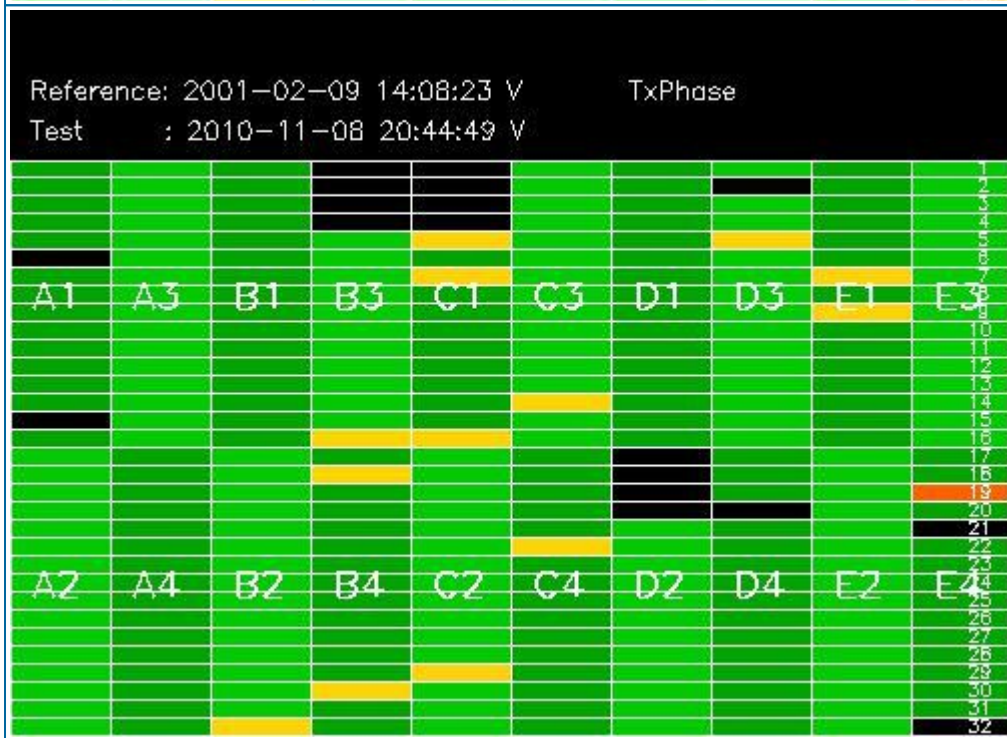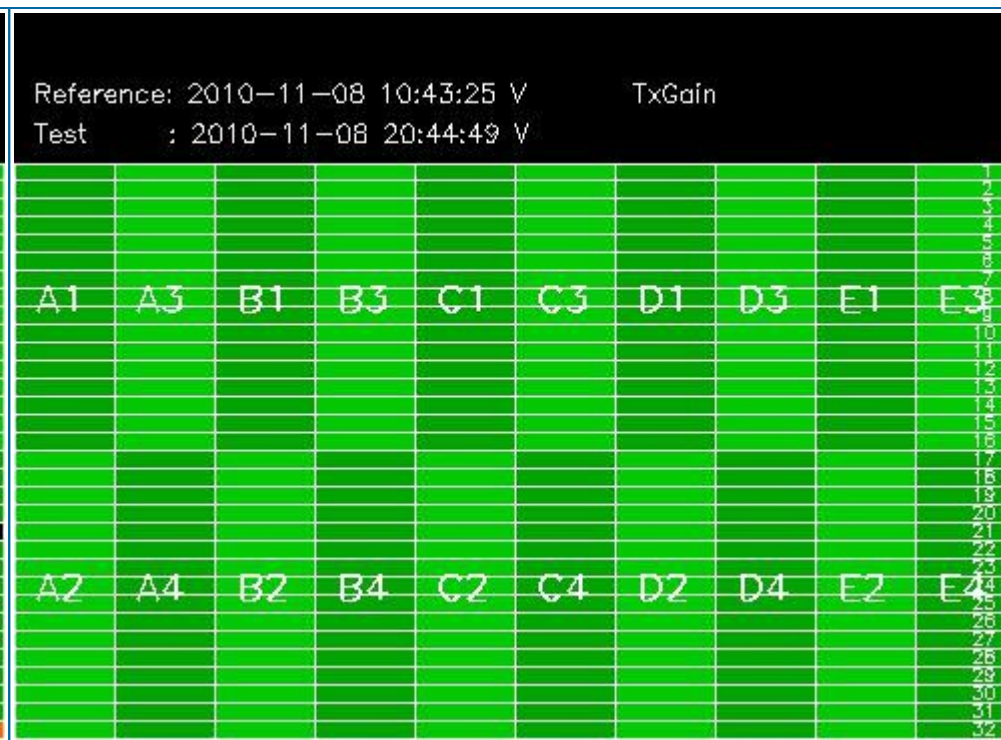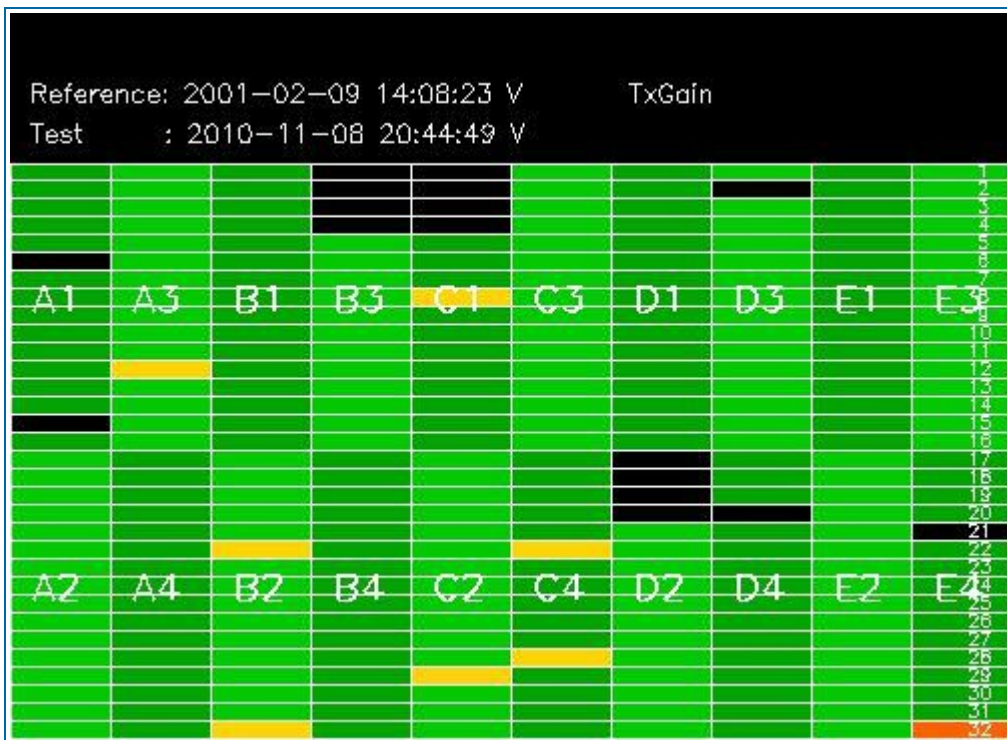


### 3.2 - H/H polarisation


[ BACK TO MENU ]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
Pre-launch reference (2001-02-09)	Previous product in the same polarisation

Reference: 2001-02-09 13:50:42 H RxGain  
 Test : 2010-11-08 15:44:07 H

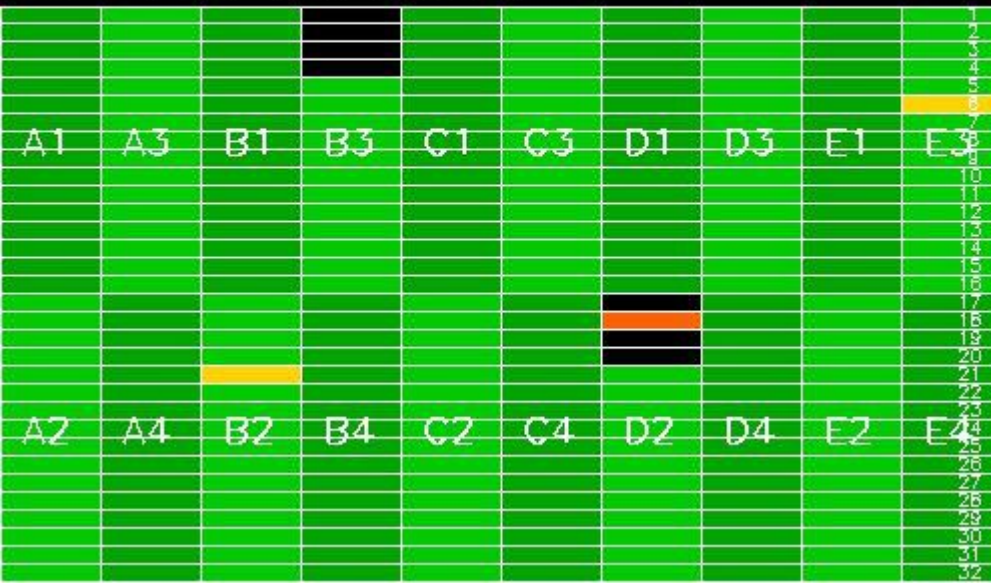


Reference: 2010-11-08 05:42:43 H RxGain  
 Test : 2010-11-08 15:44:07 H




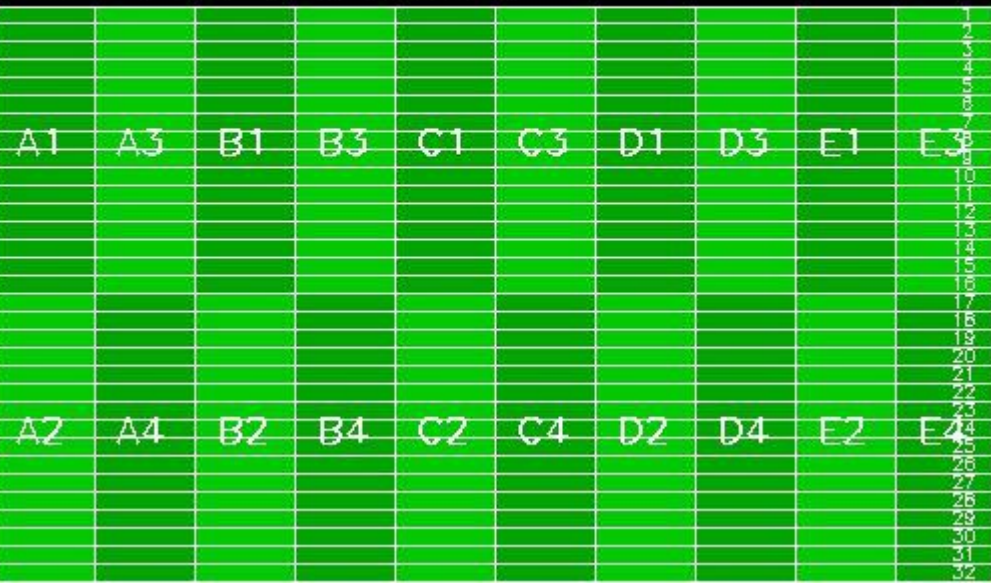


Reference: 2001-02-09 13:50:42 H RxPhase  
 Test : 2010-11-08 15:44:07 H



Reference: 2010-11-08 05:42:43 H RxPhase  
 Test : 2010-11-08 15:44:07 H

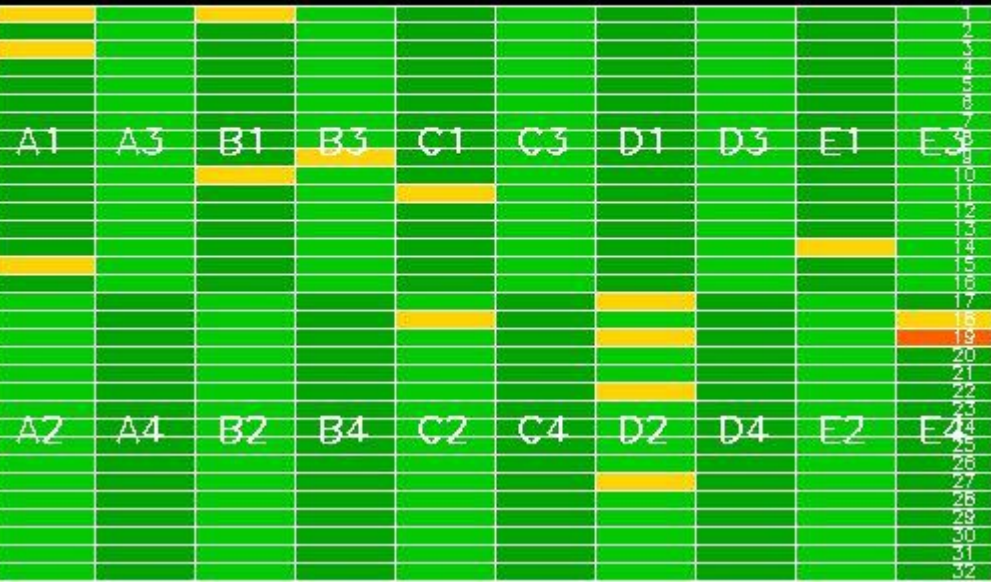

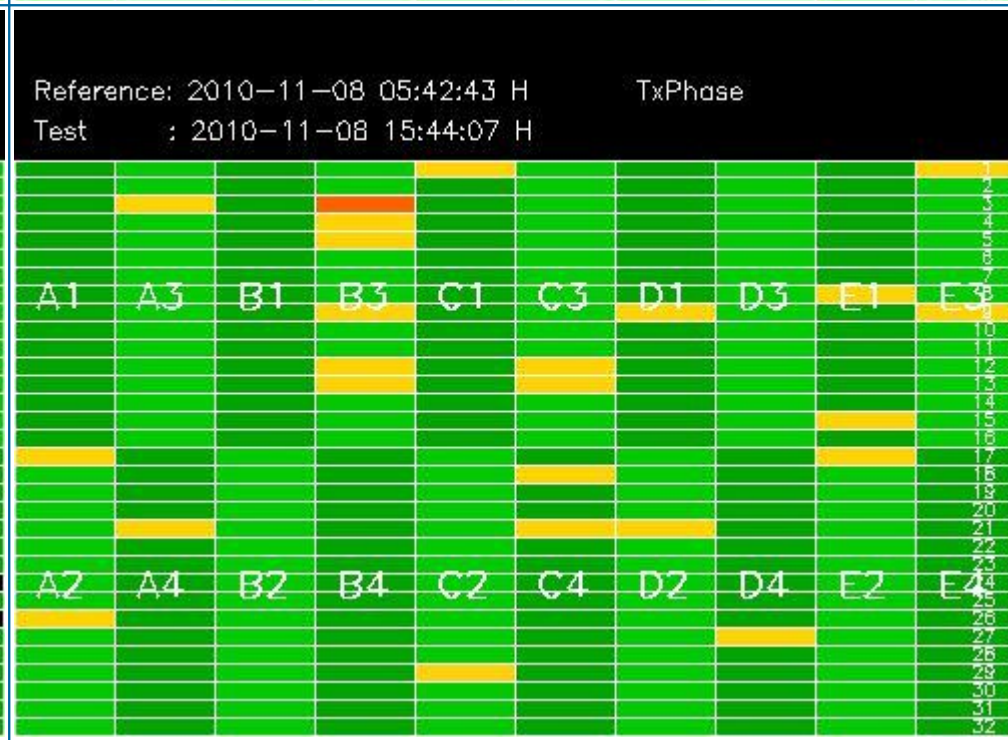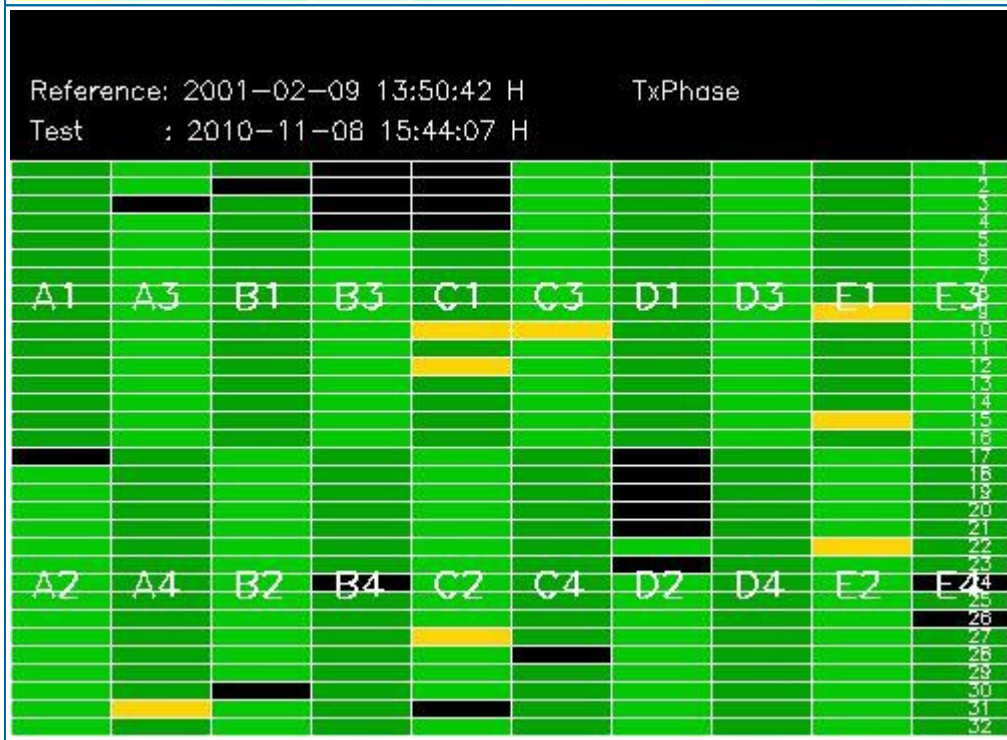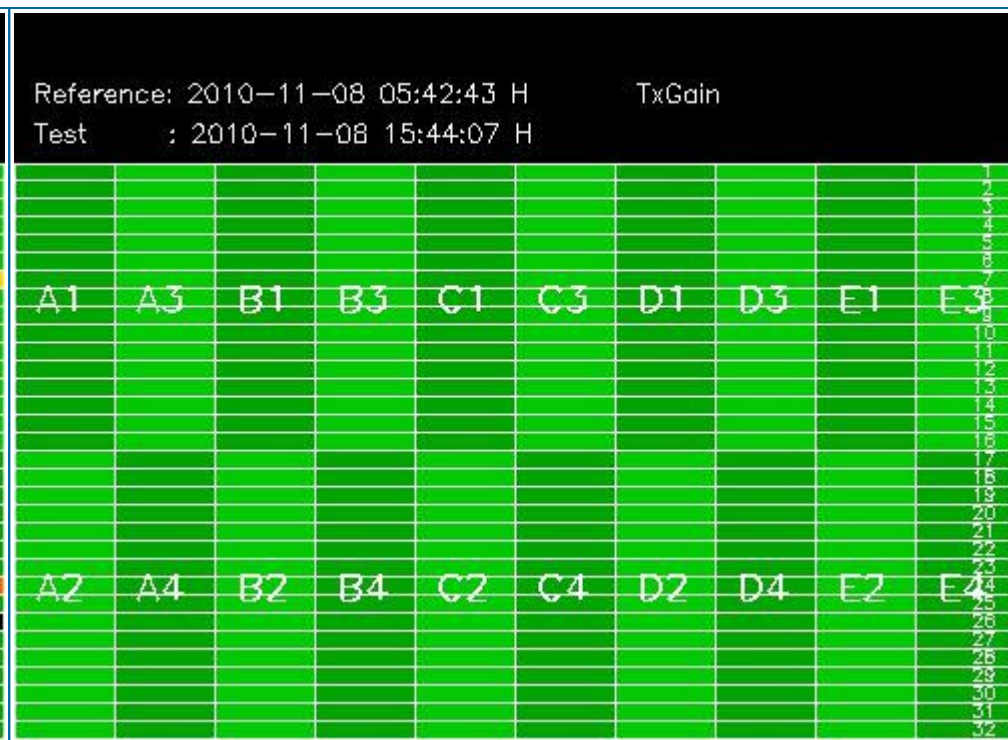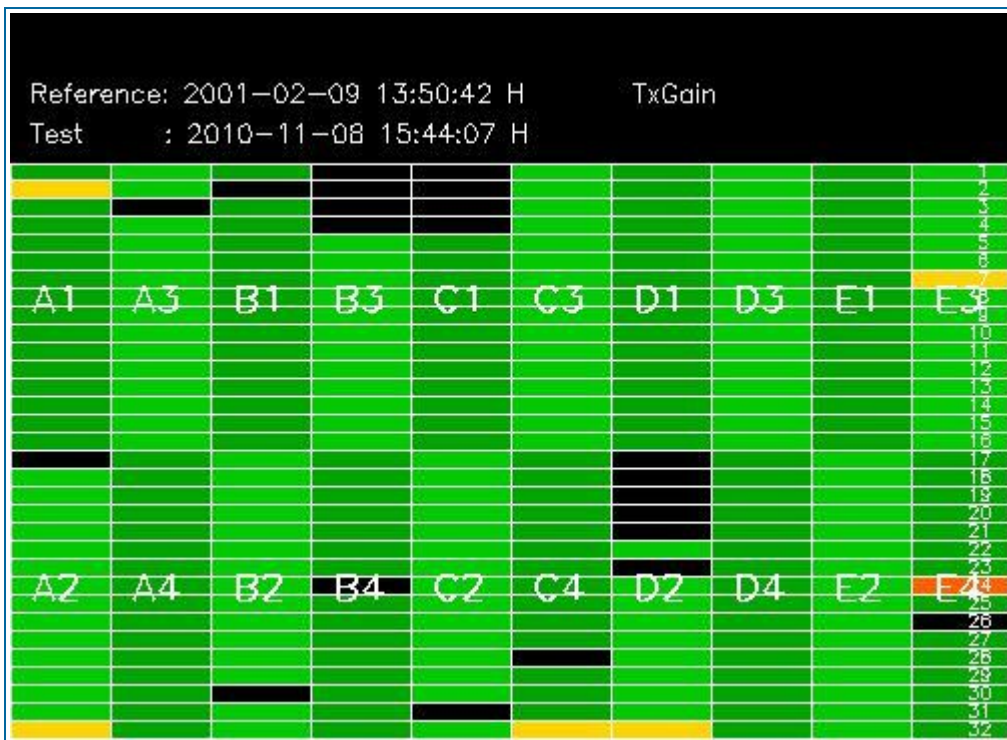

#### 4 - CALIBRATION PULSES ANALYSIS


##### 4.1 - Analysis for WVS IS2 V/V

##### 4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V


[ BACK TO MENU ]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]	Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]
---	---

Calibration pulses for WVS IS2 V/V

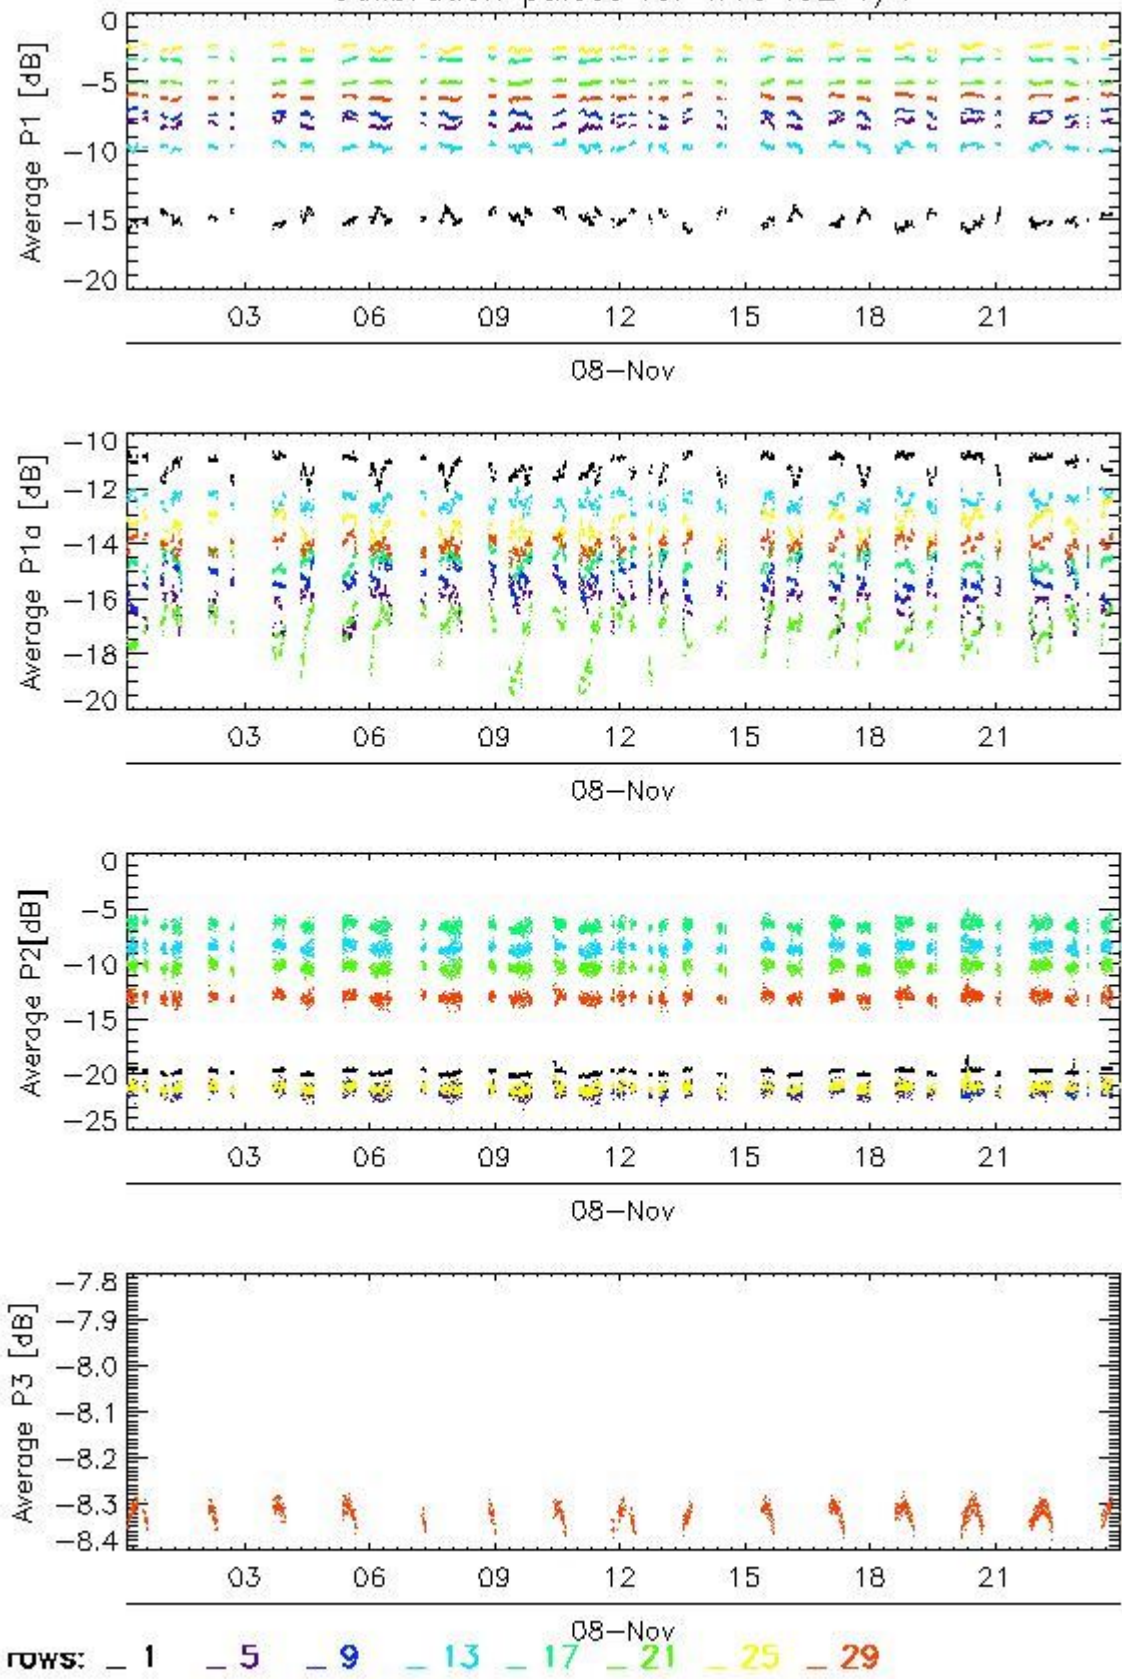


Transmit power (P1 - P1a) for WVS IS2 V/V

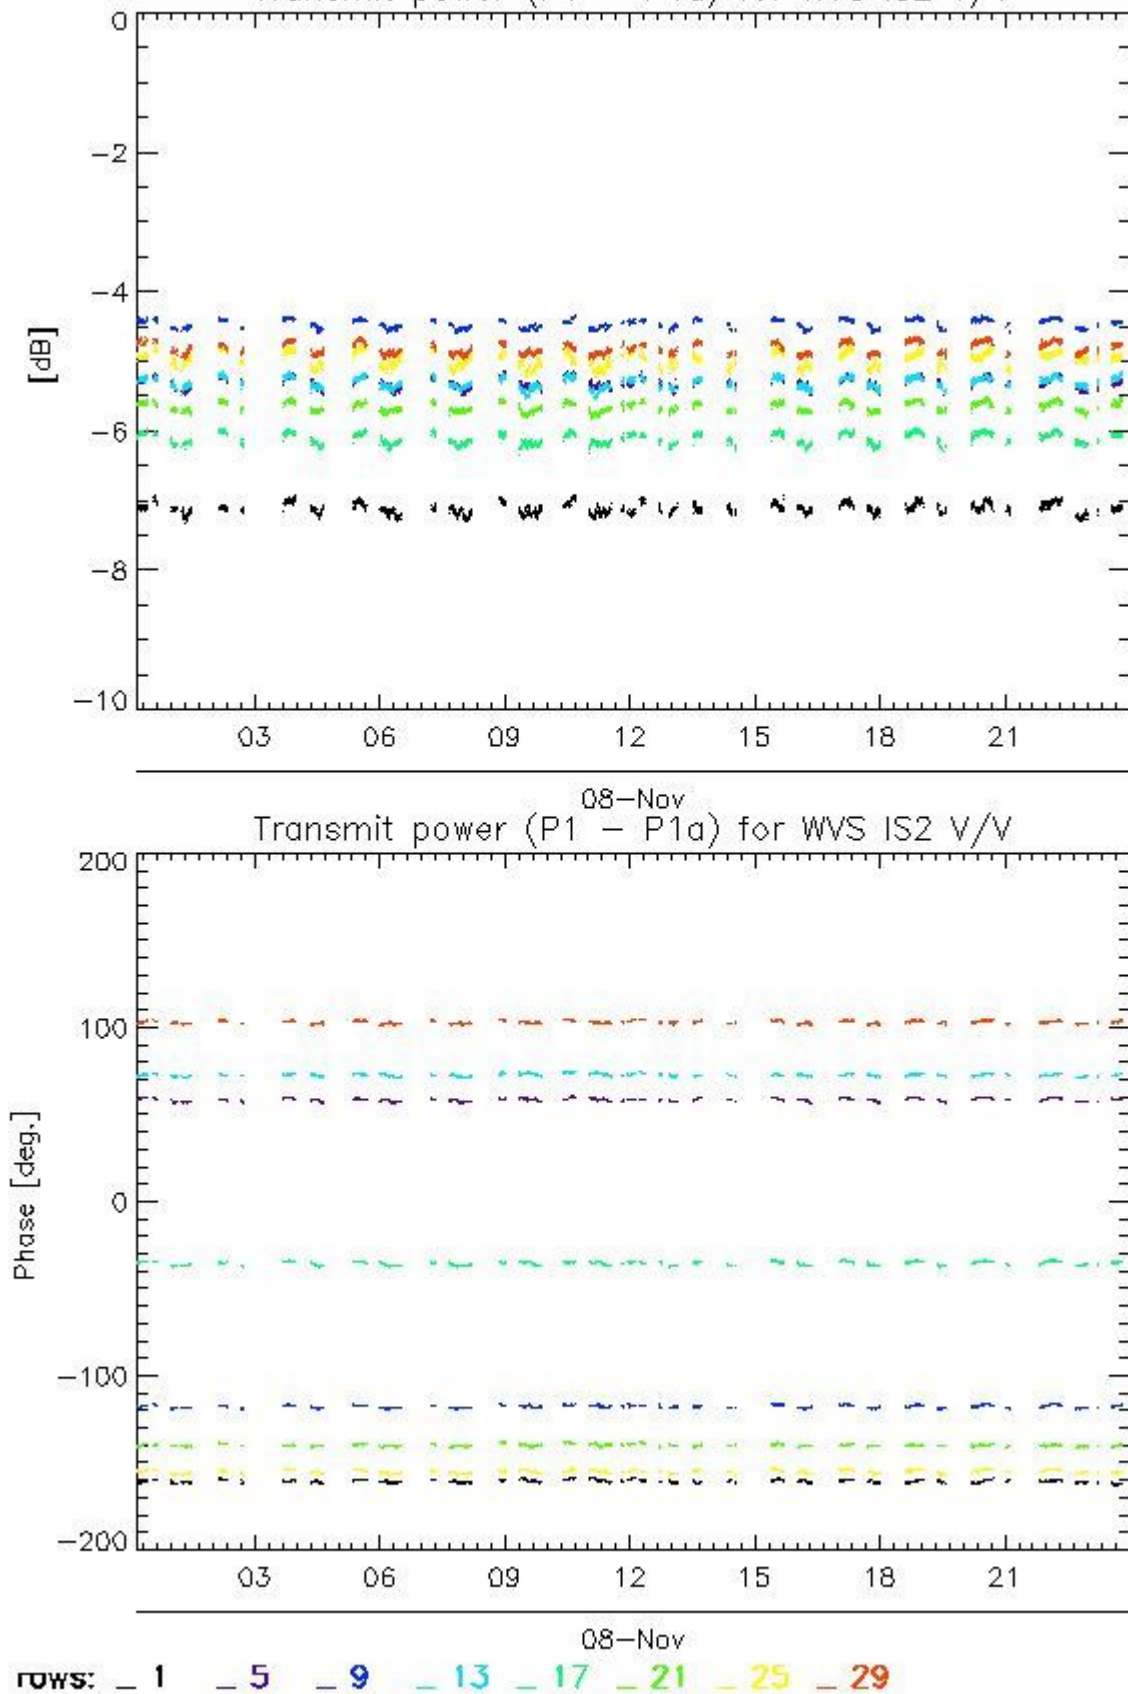

#### 4.1.2 - All Rows Analysis for WVS IS2 V/V

[ [BACK TO MENU](#) ]



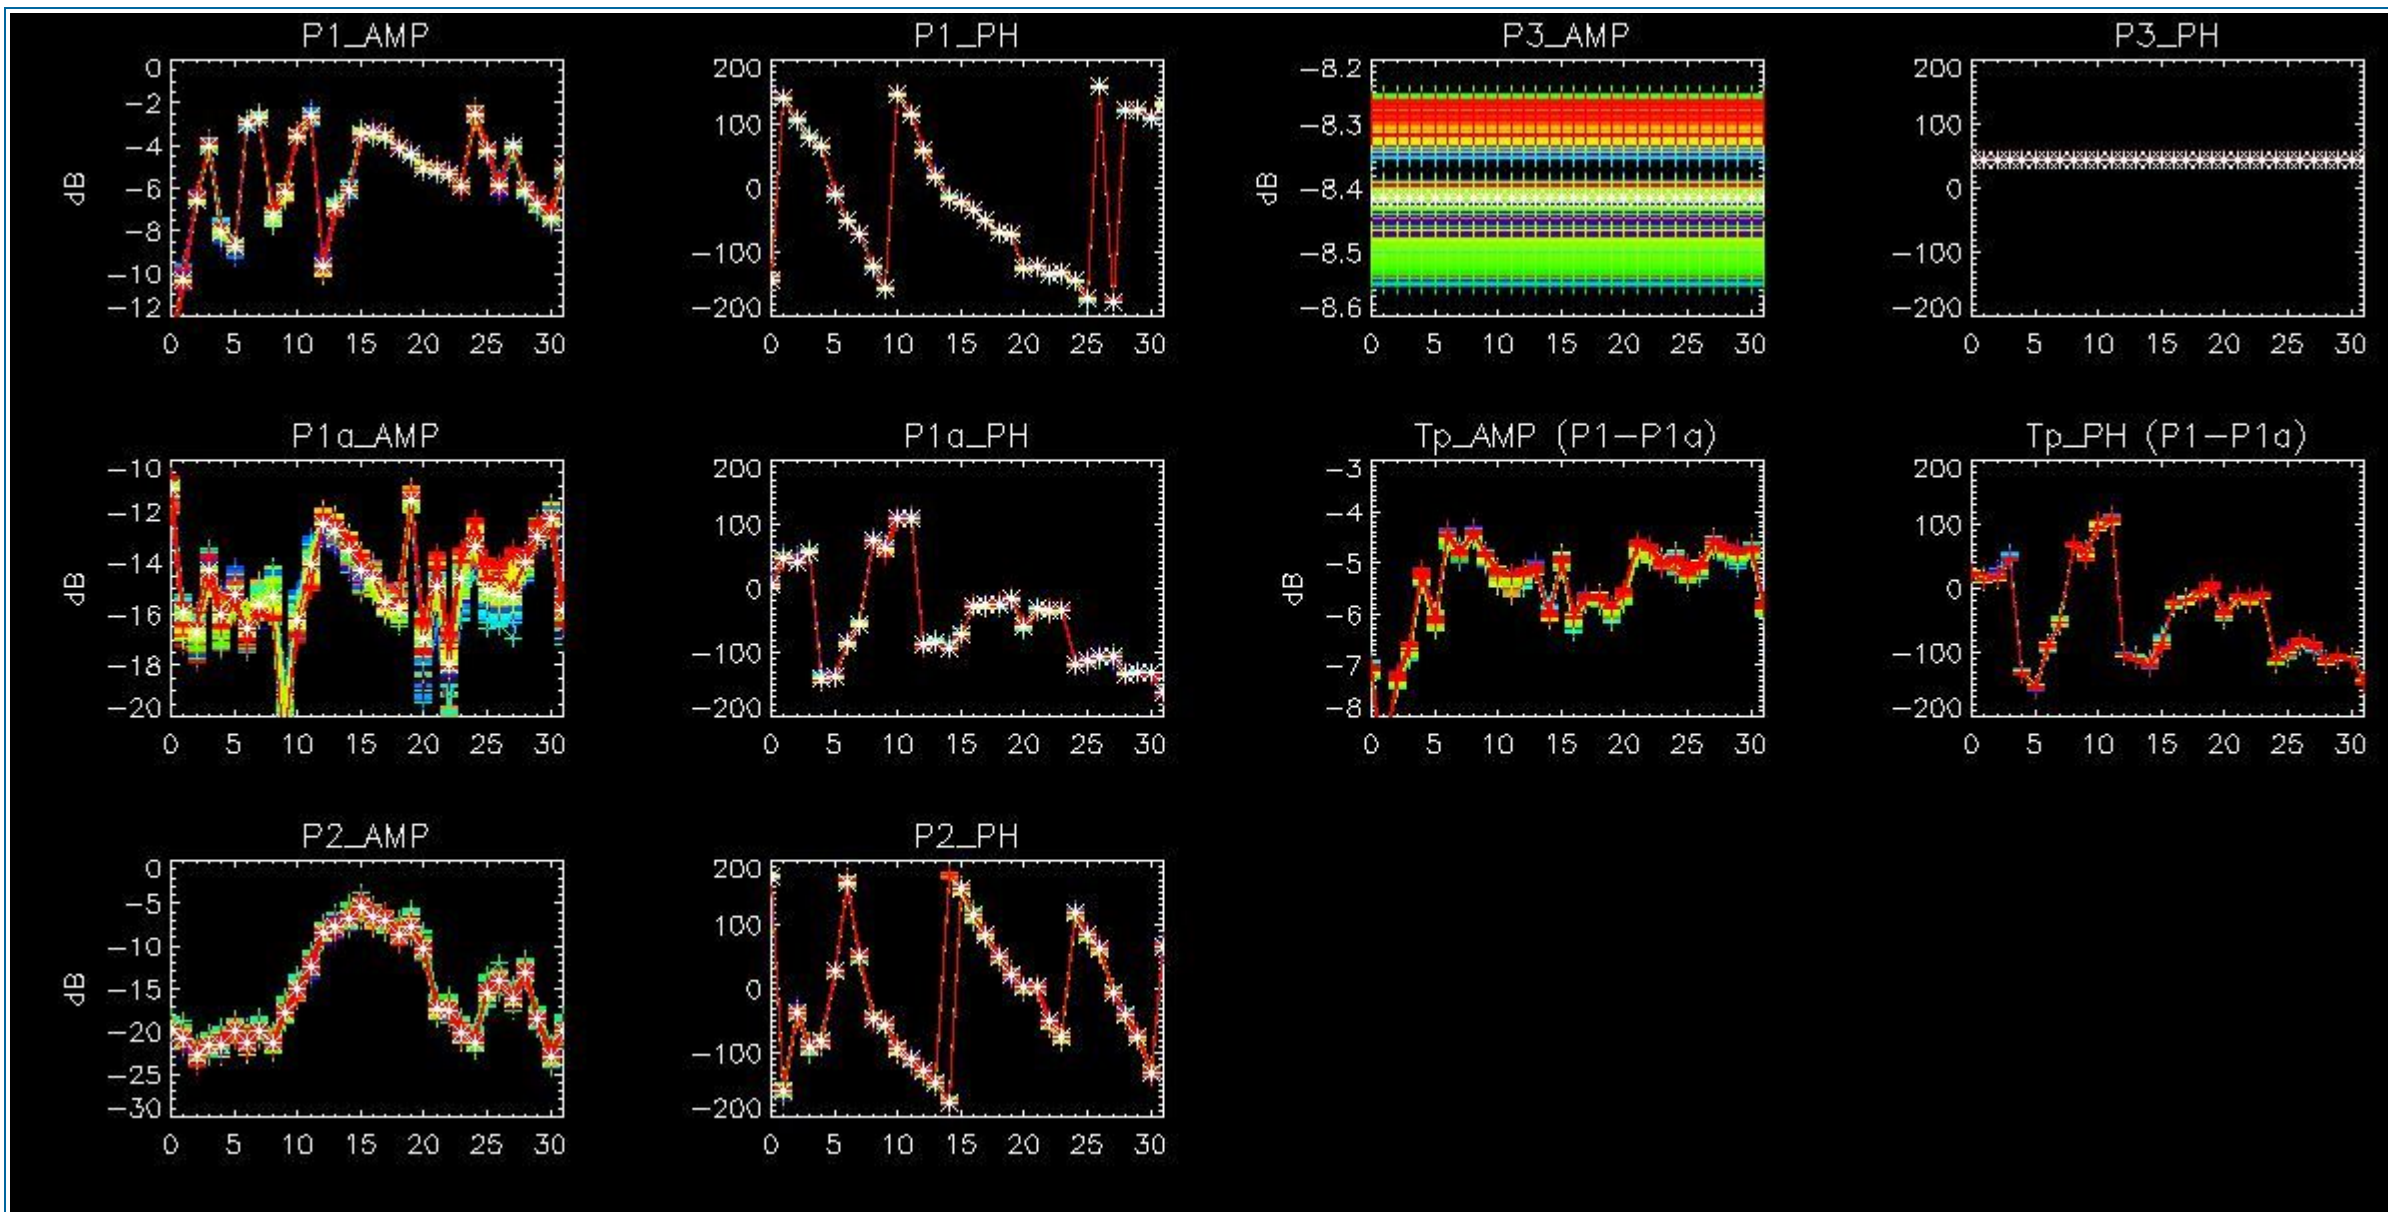

## 4.2 - Analysis for GM1 SS3 H/H

### 4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H


[ BACK TO MENU ]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]



Calibration pulses for GM1 SS3 H/H

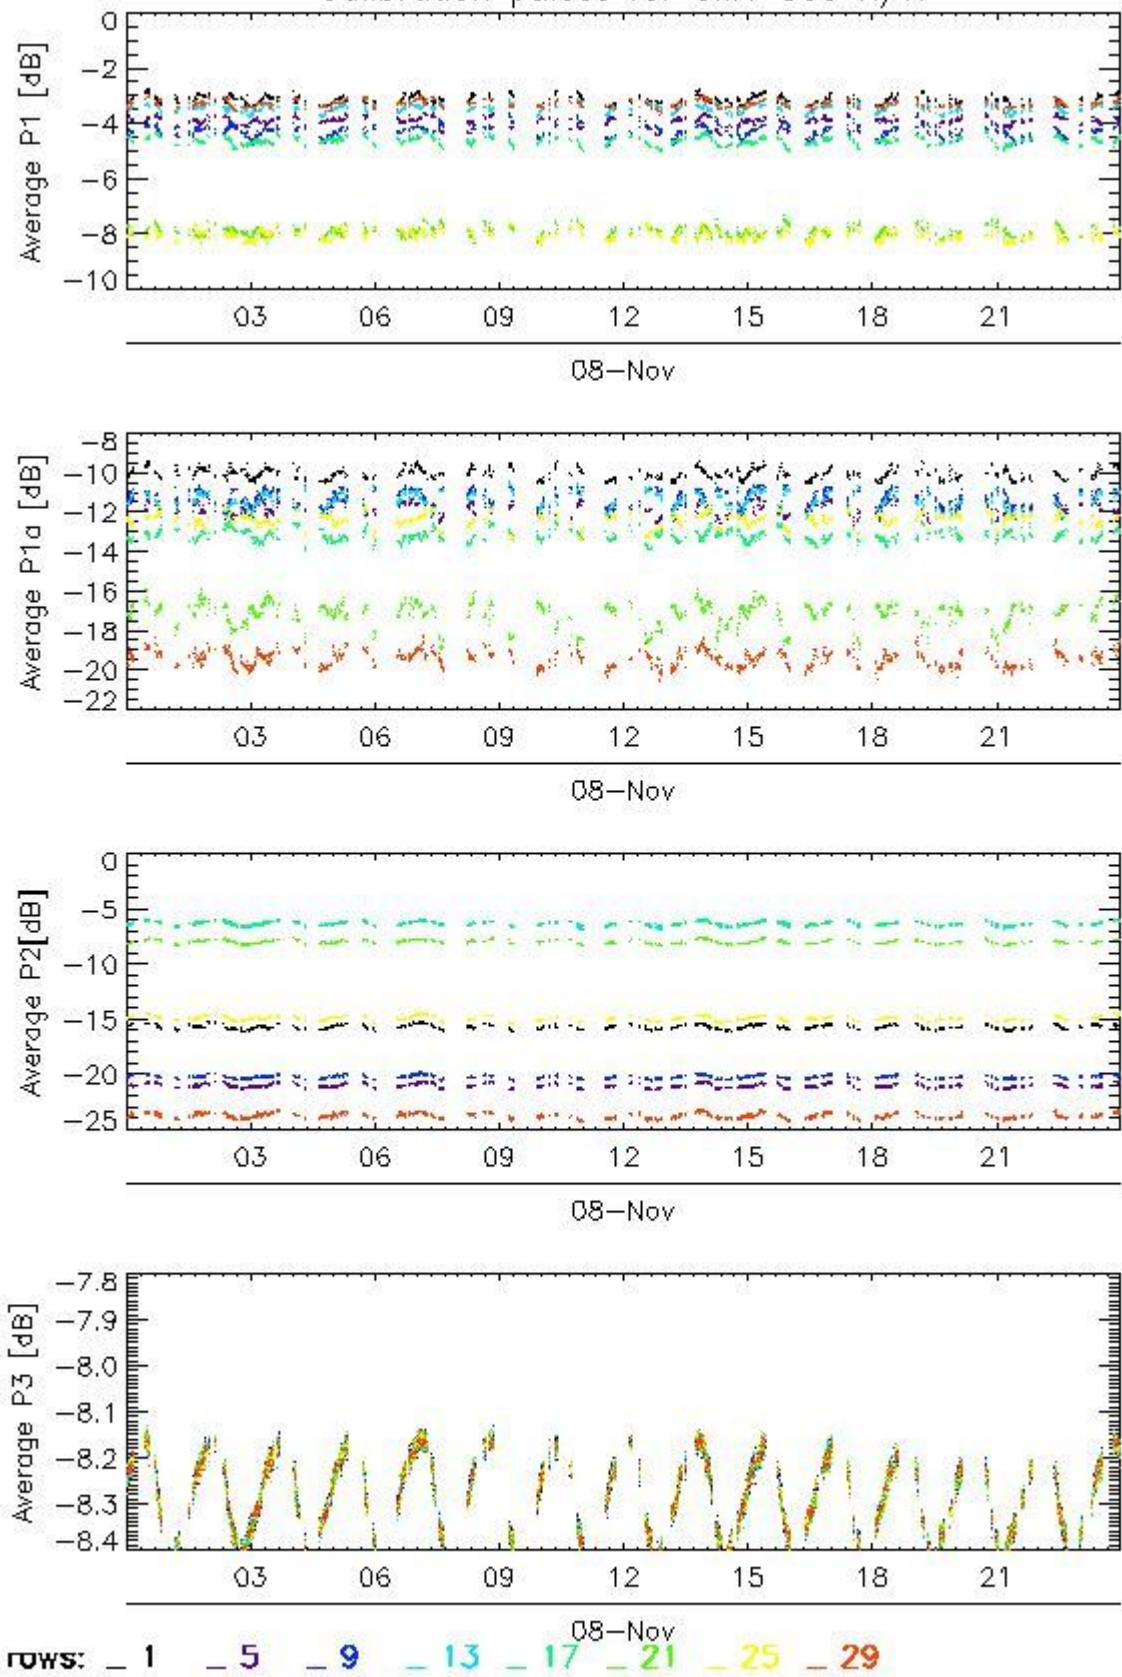


Transmit power (P1 - P1a) for GM1 SS3 H/H

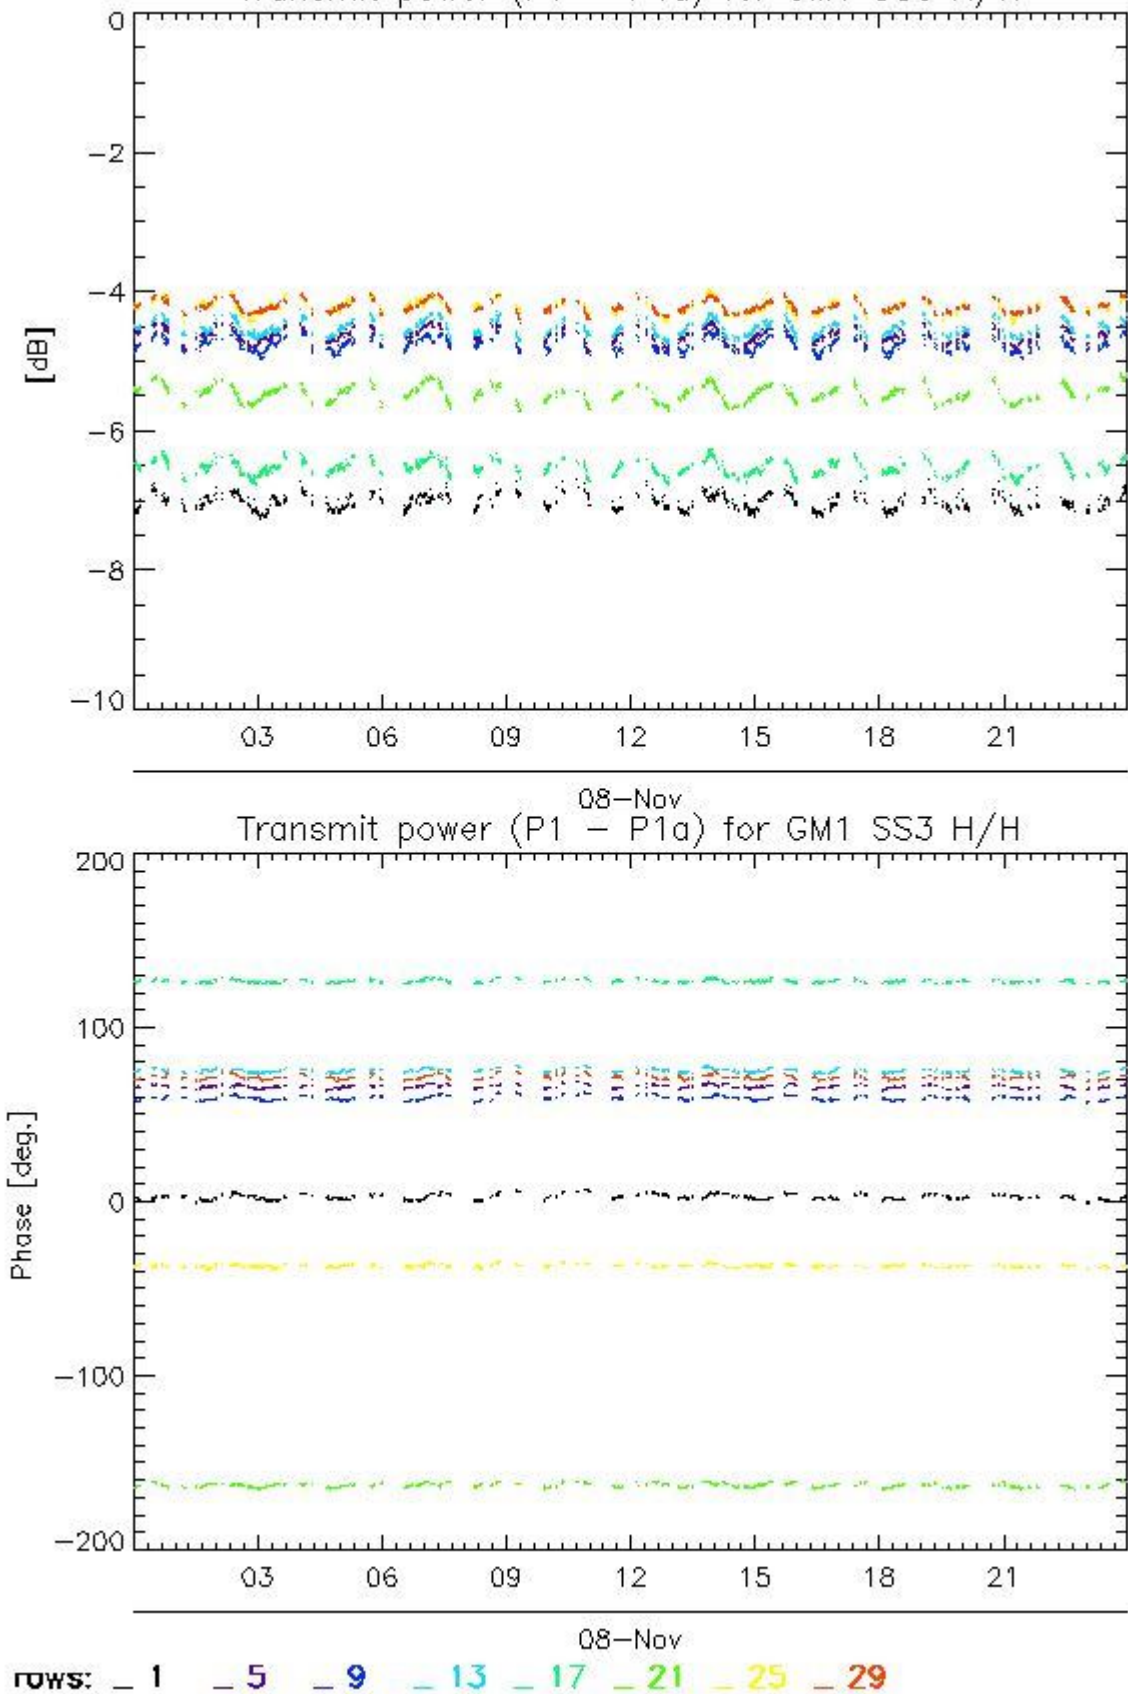

4.2.2 - All Rows Analysis for GM1 SS3 H/H

[ BACK TO MENU ]



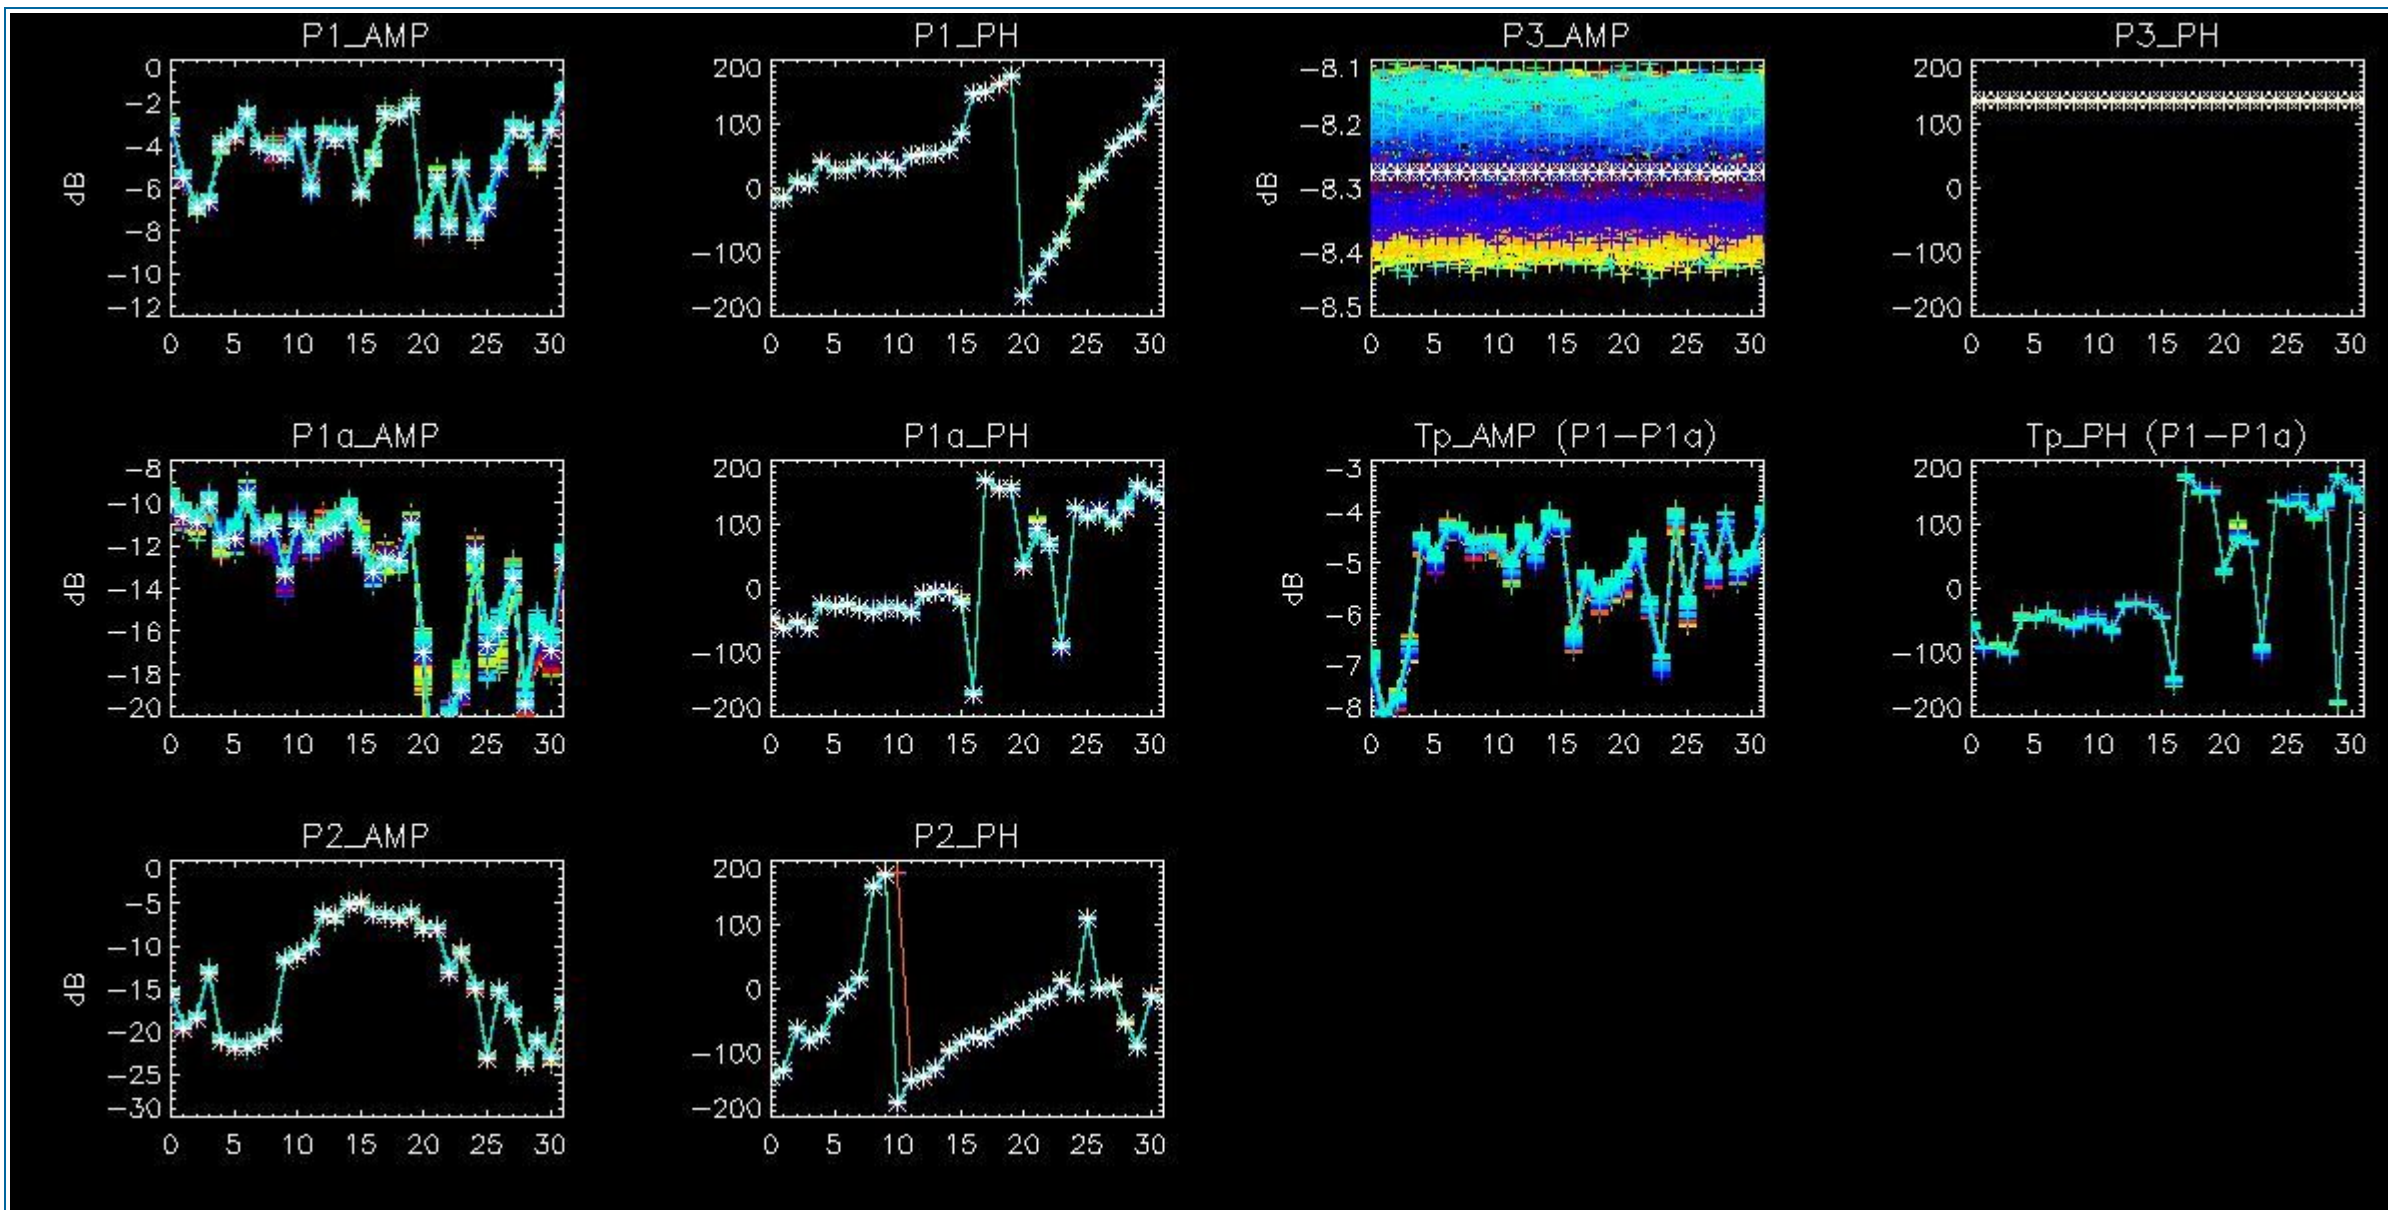


## 5 - DOPPLER ANALYSIS

### 5.1 - Analysis for WVS IS2 V/V

#### 5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[ [BACK TO MENU](#) ]




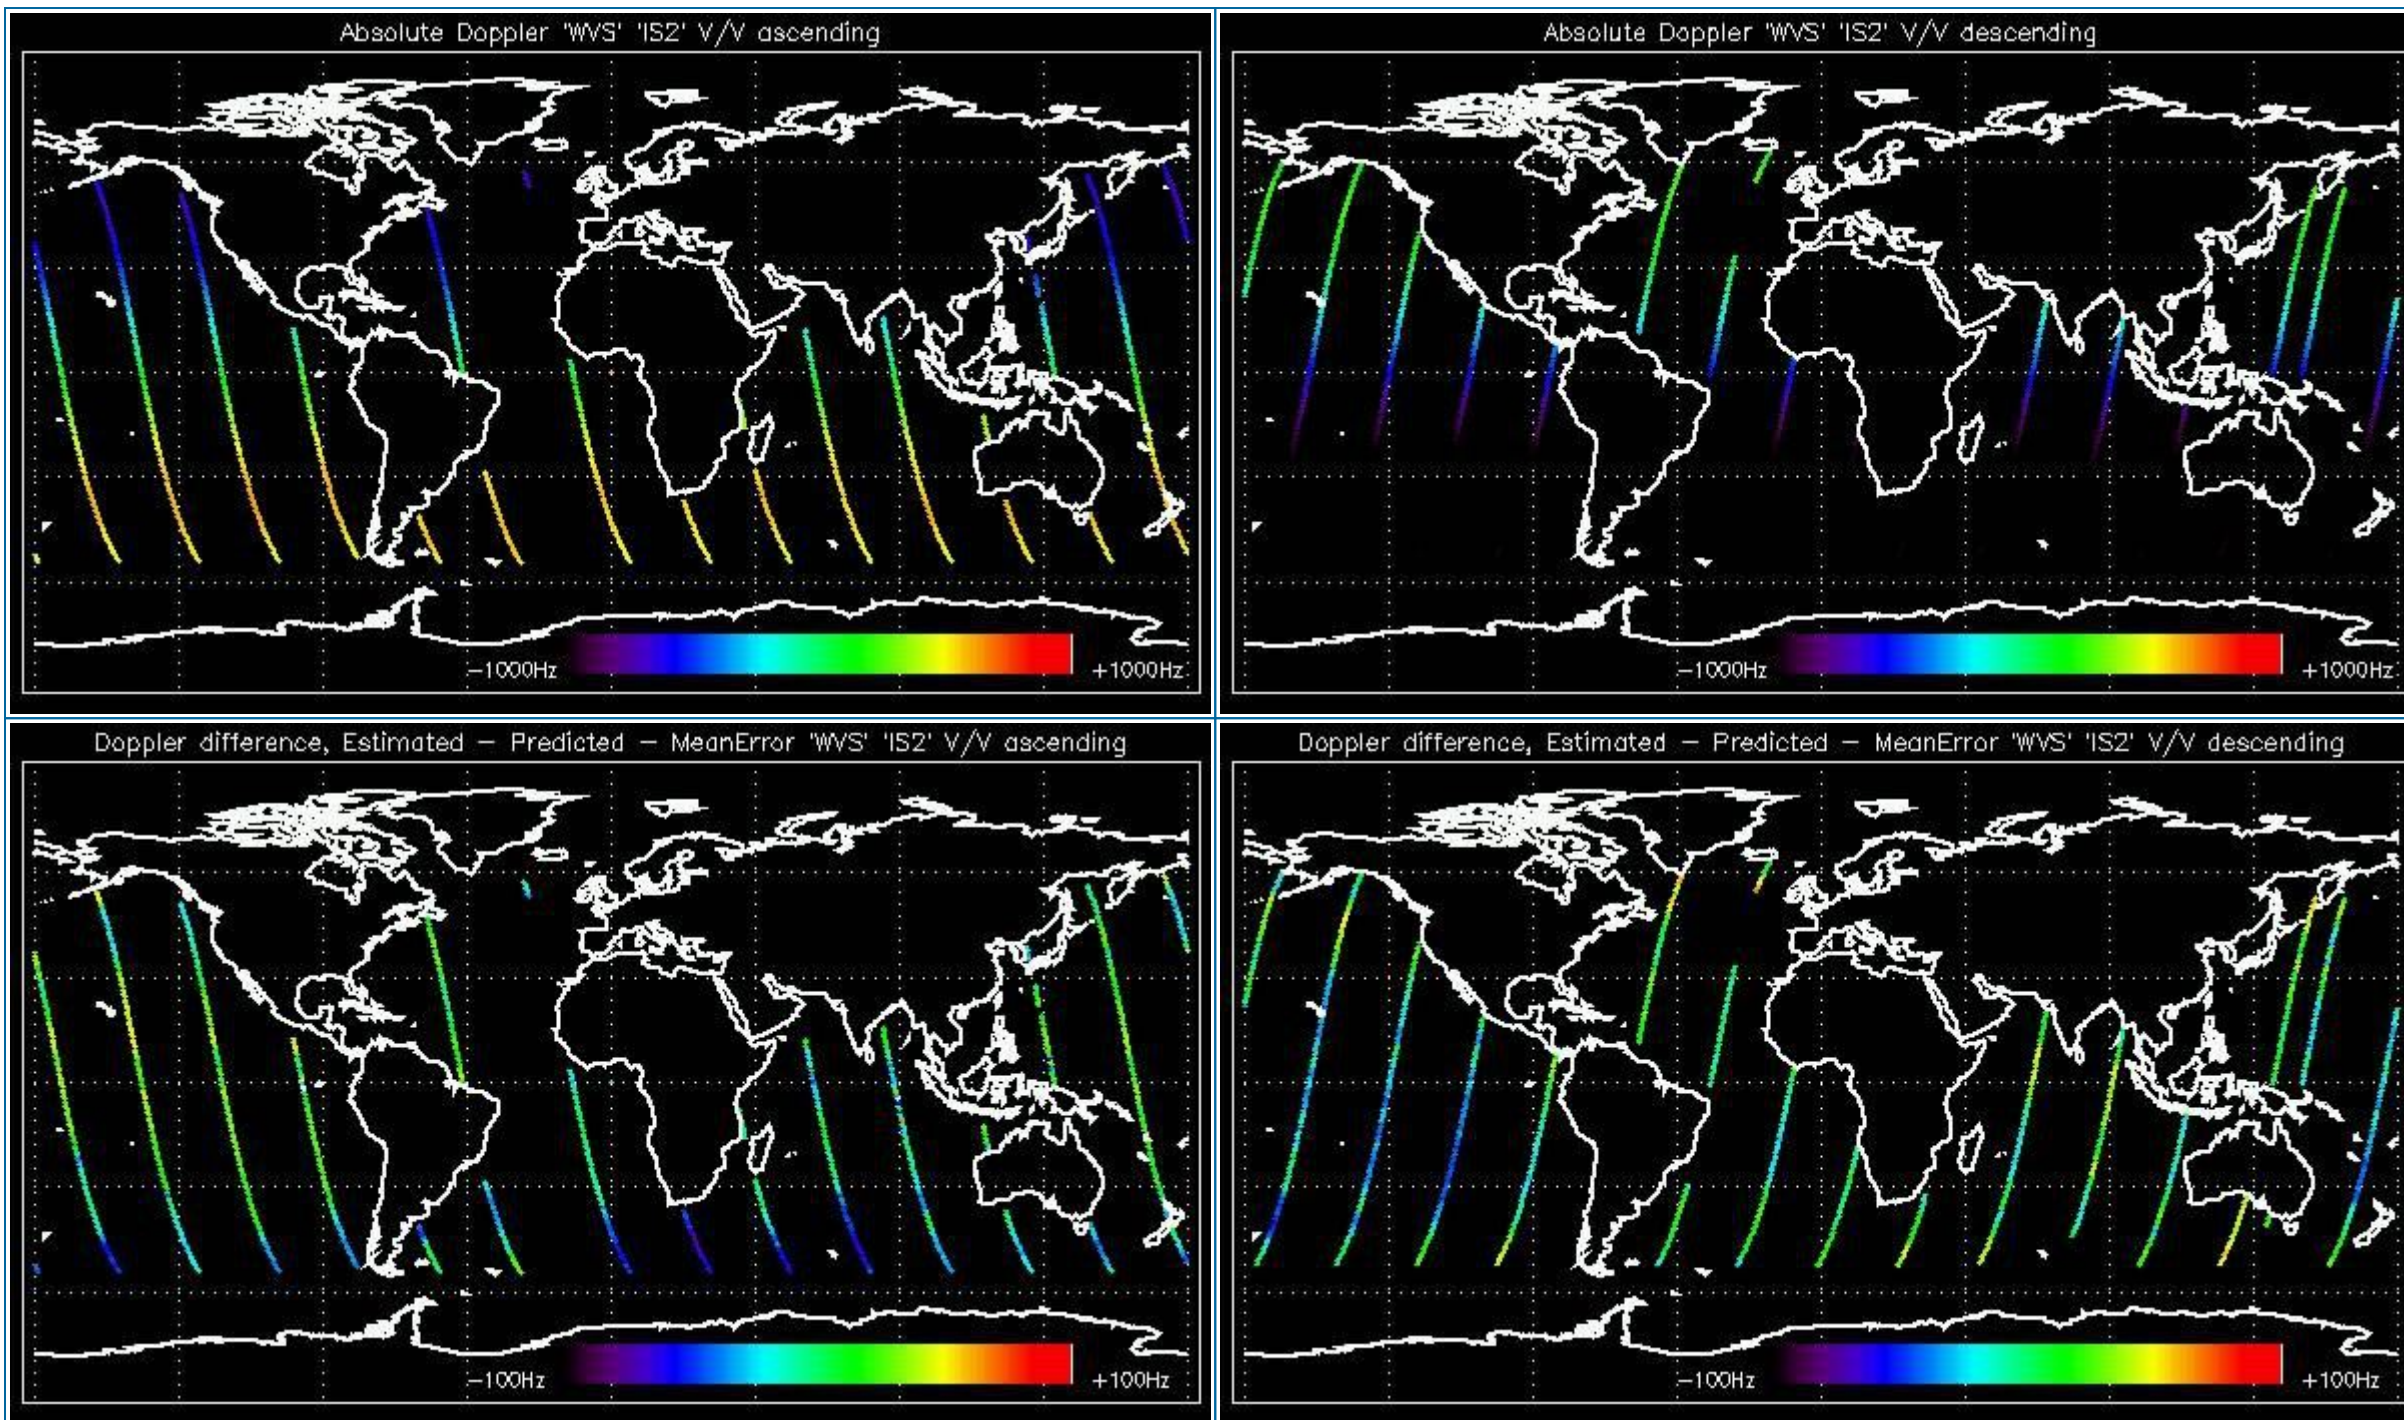

### 5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[ [BACK TO MENU](#) ]



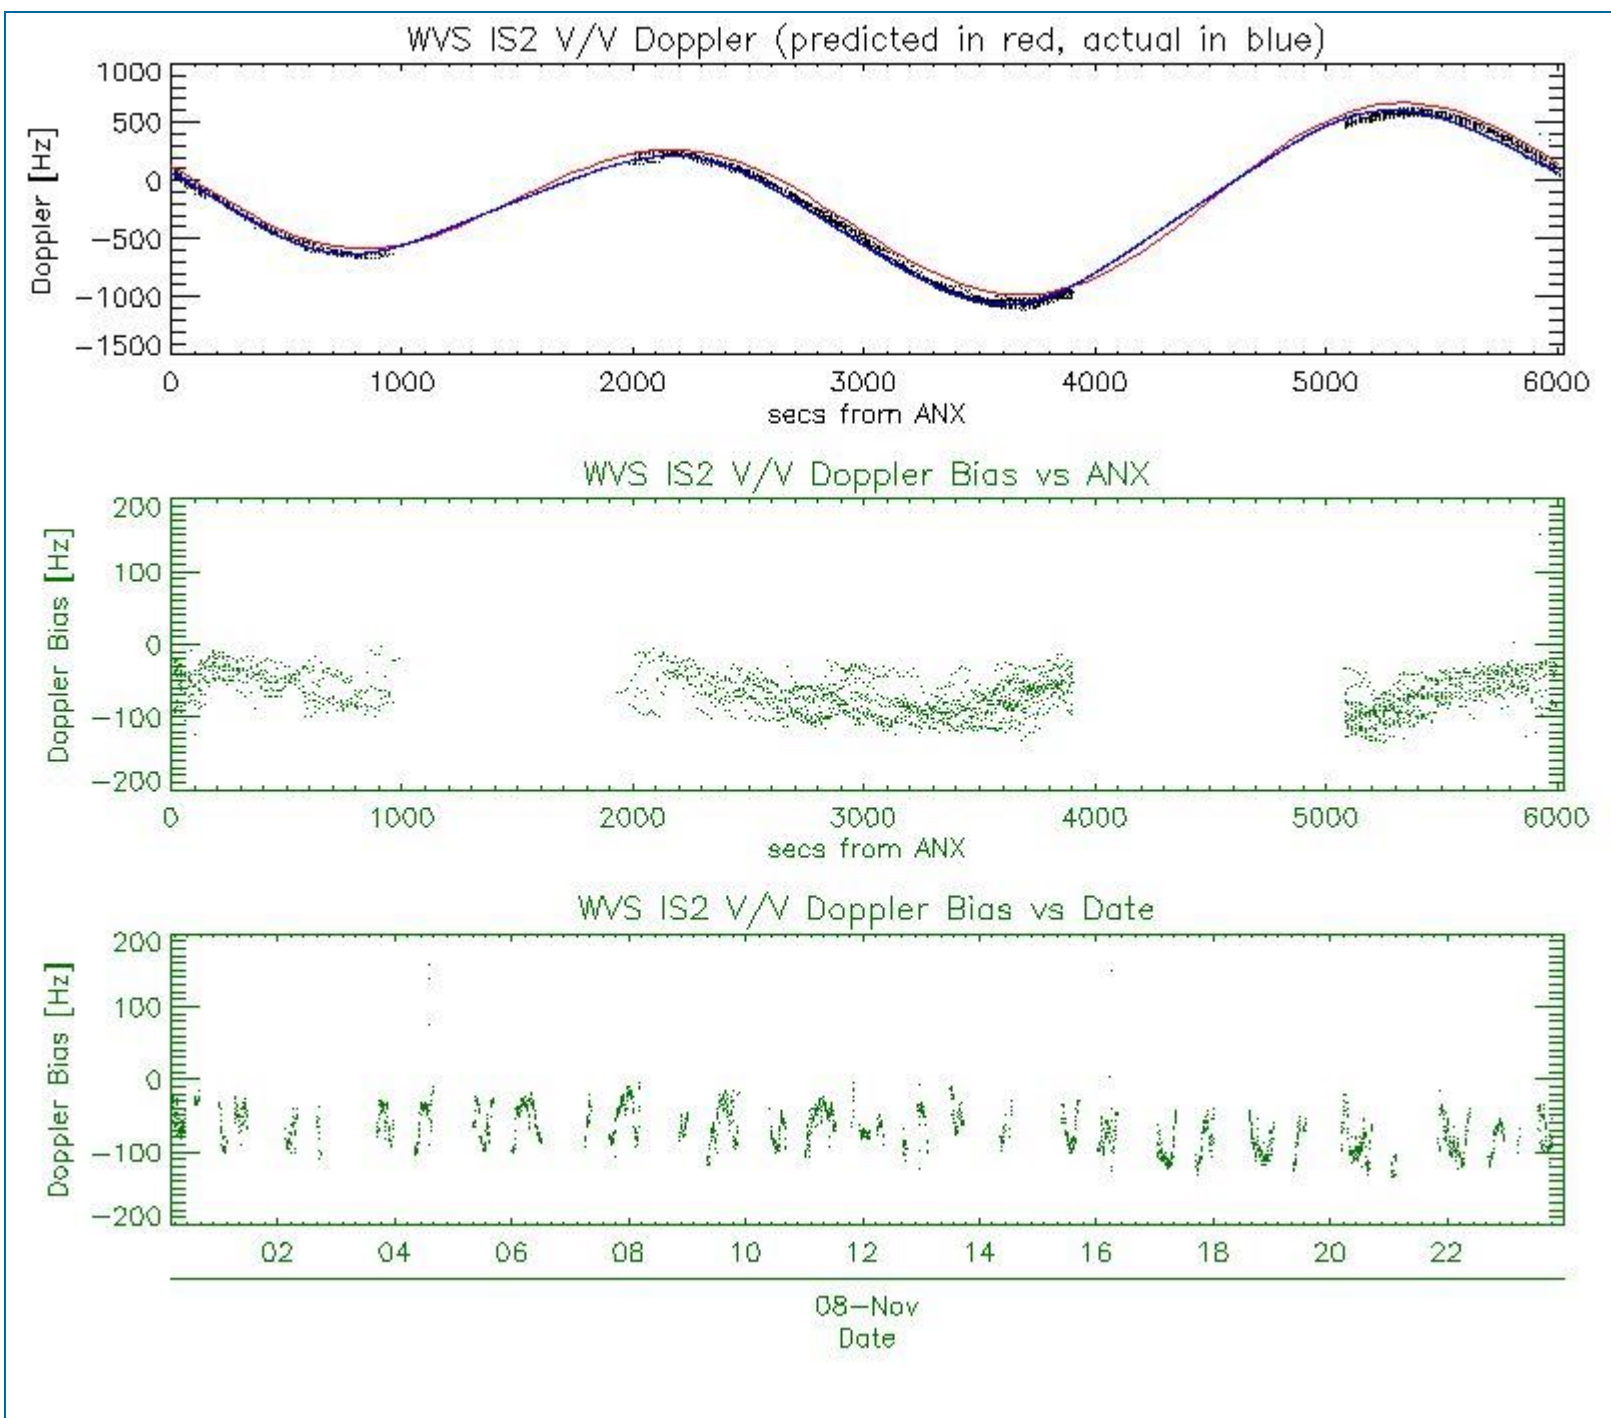


## 5.2 - Analysis for GM1 SS1 H/H

### 5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[ [BACK TO MENU](#) ]




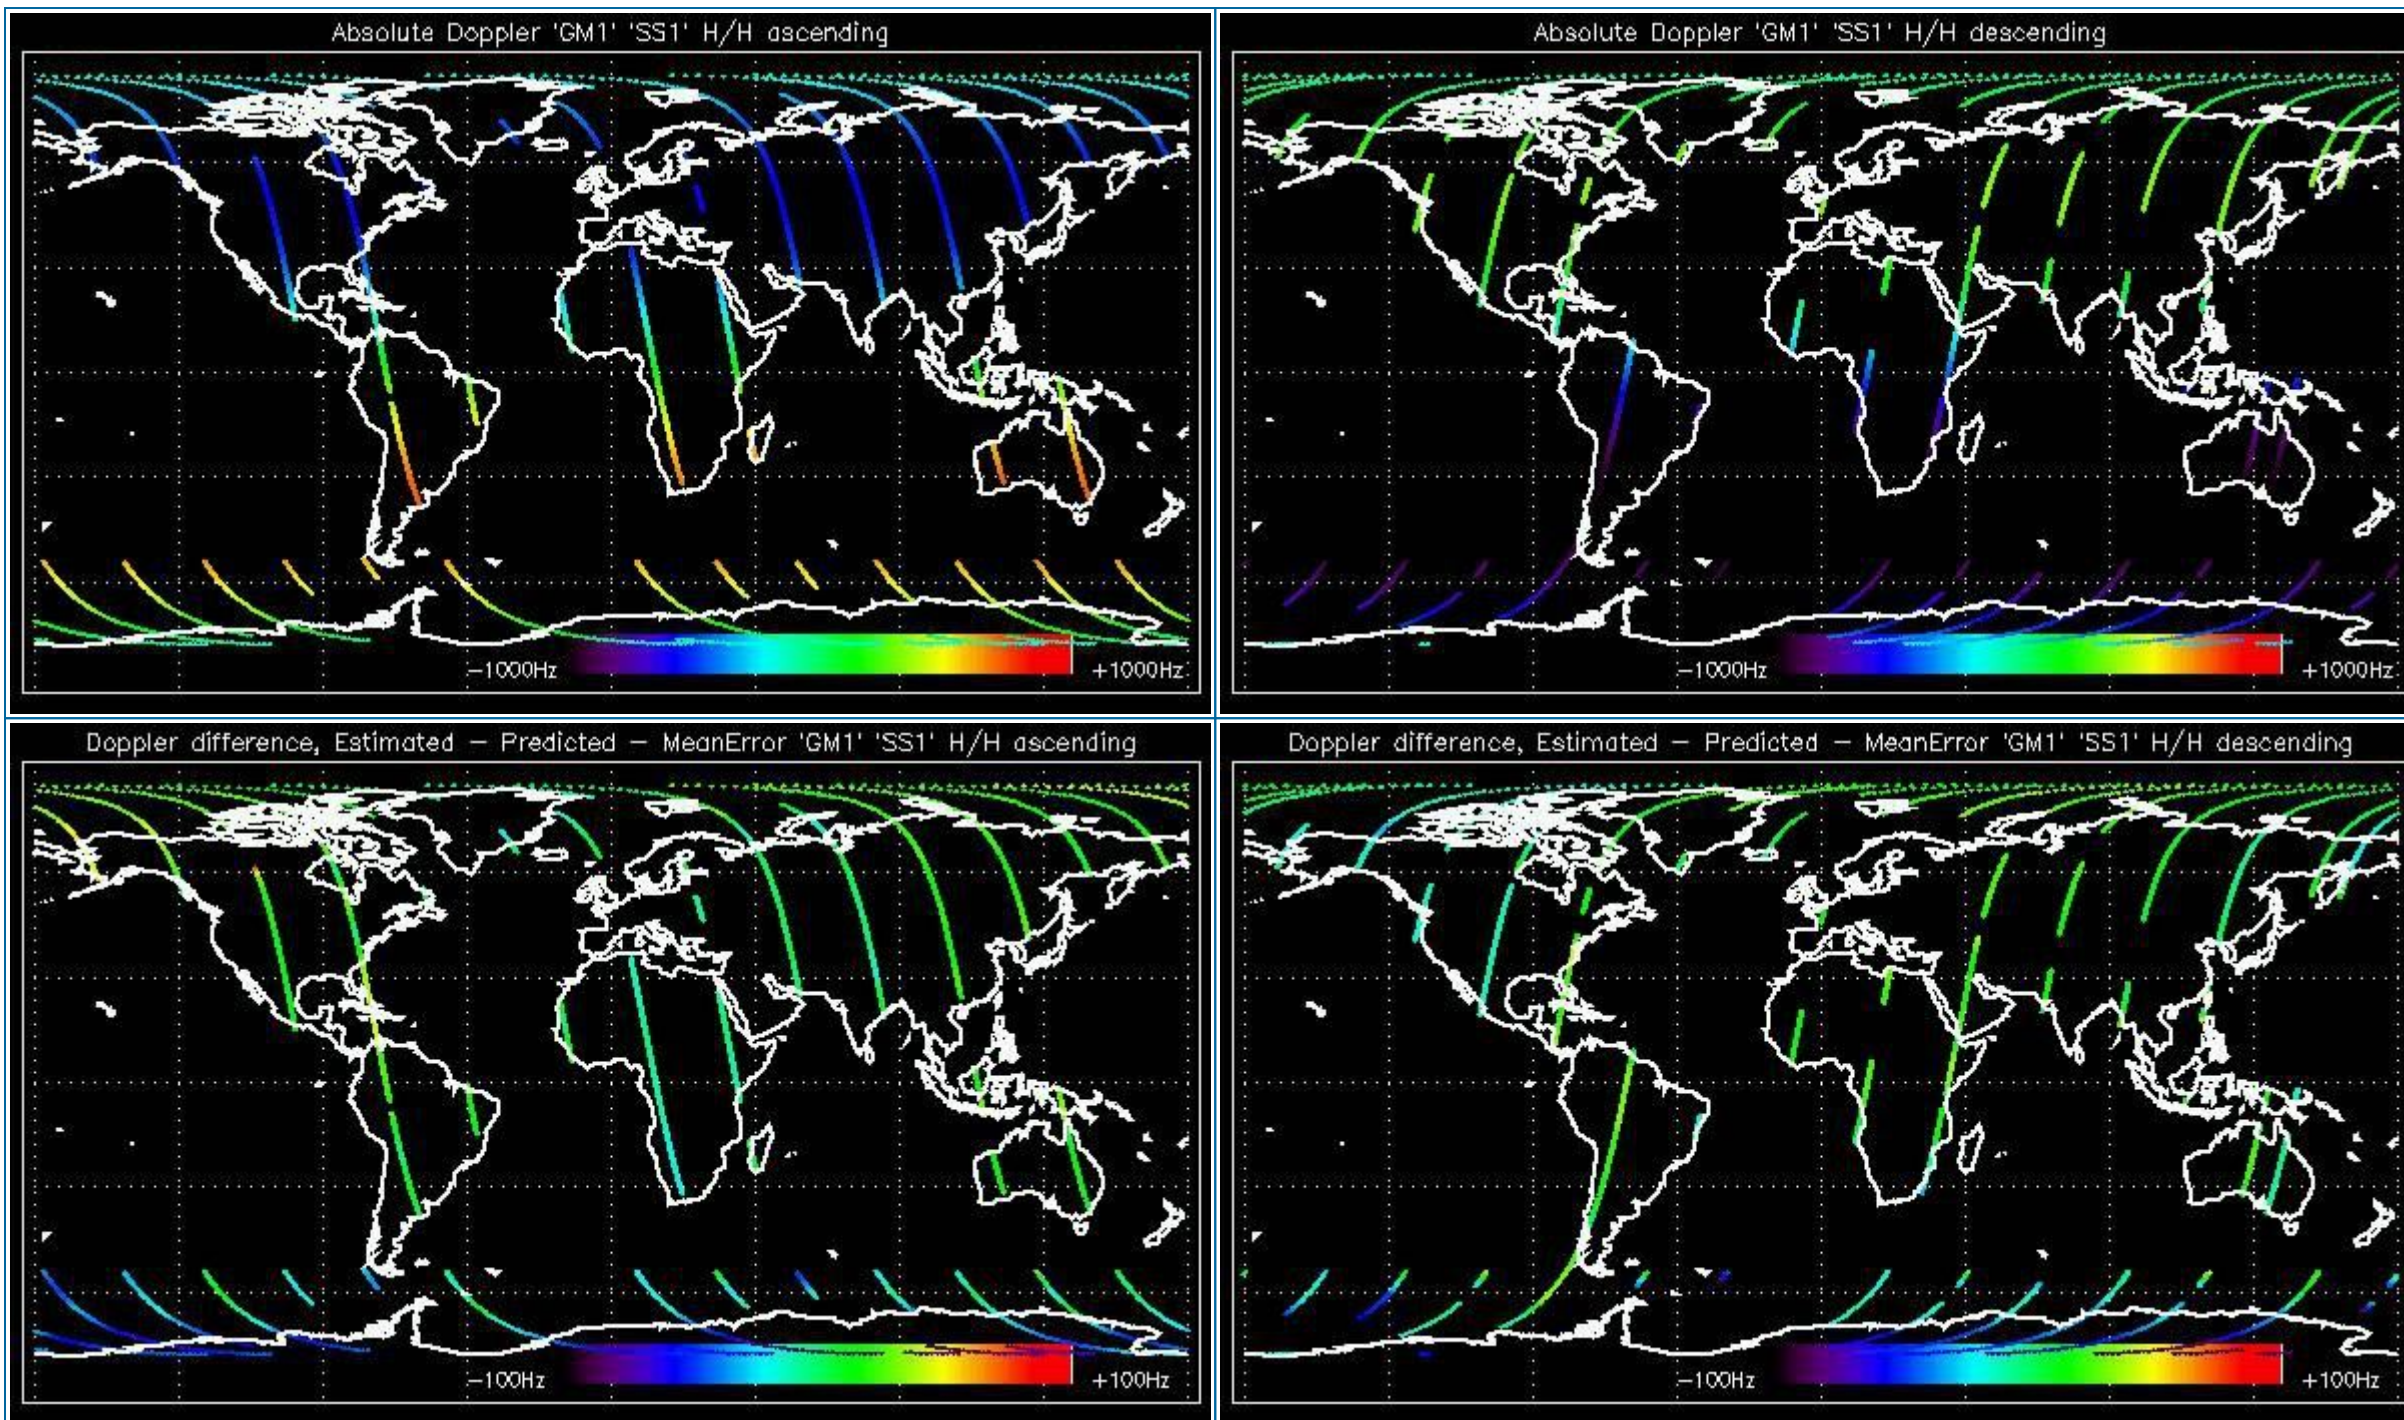

### 5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[ [BACK TO MENU](#) ]




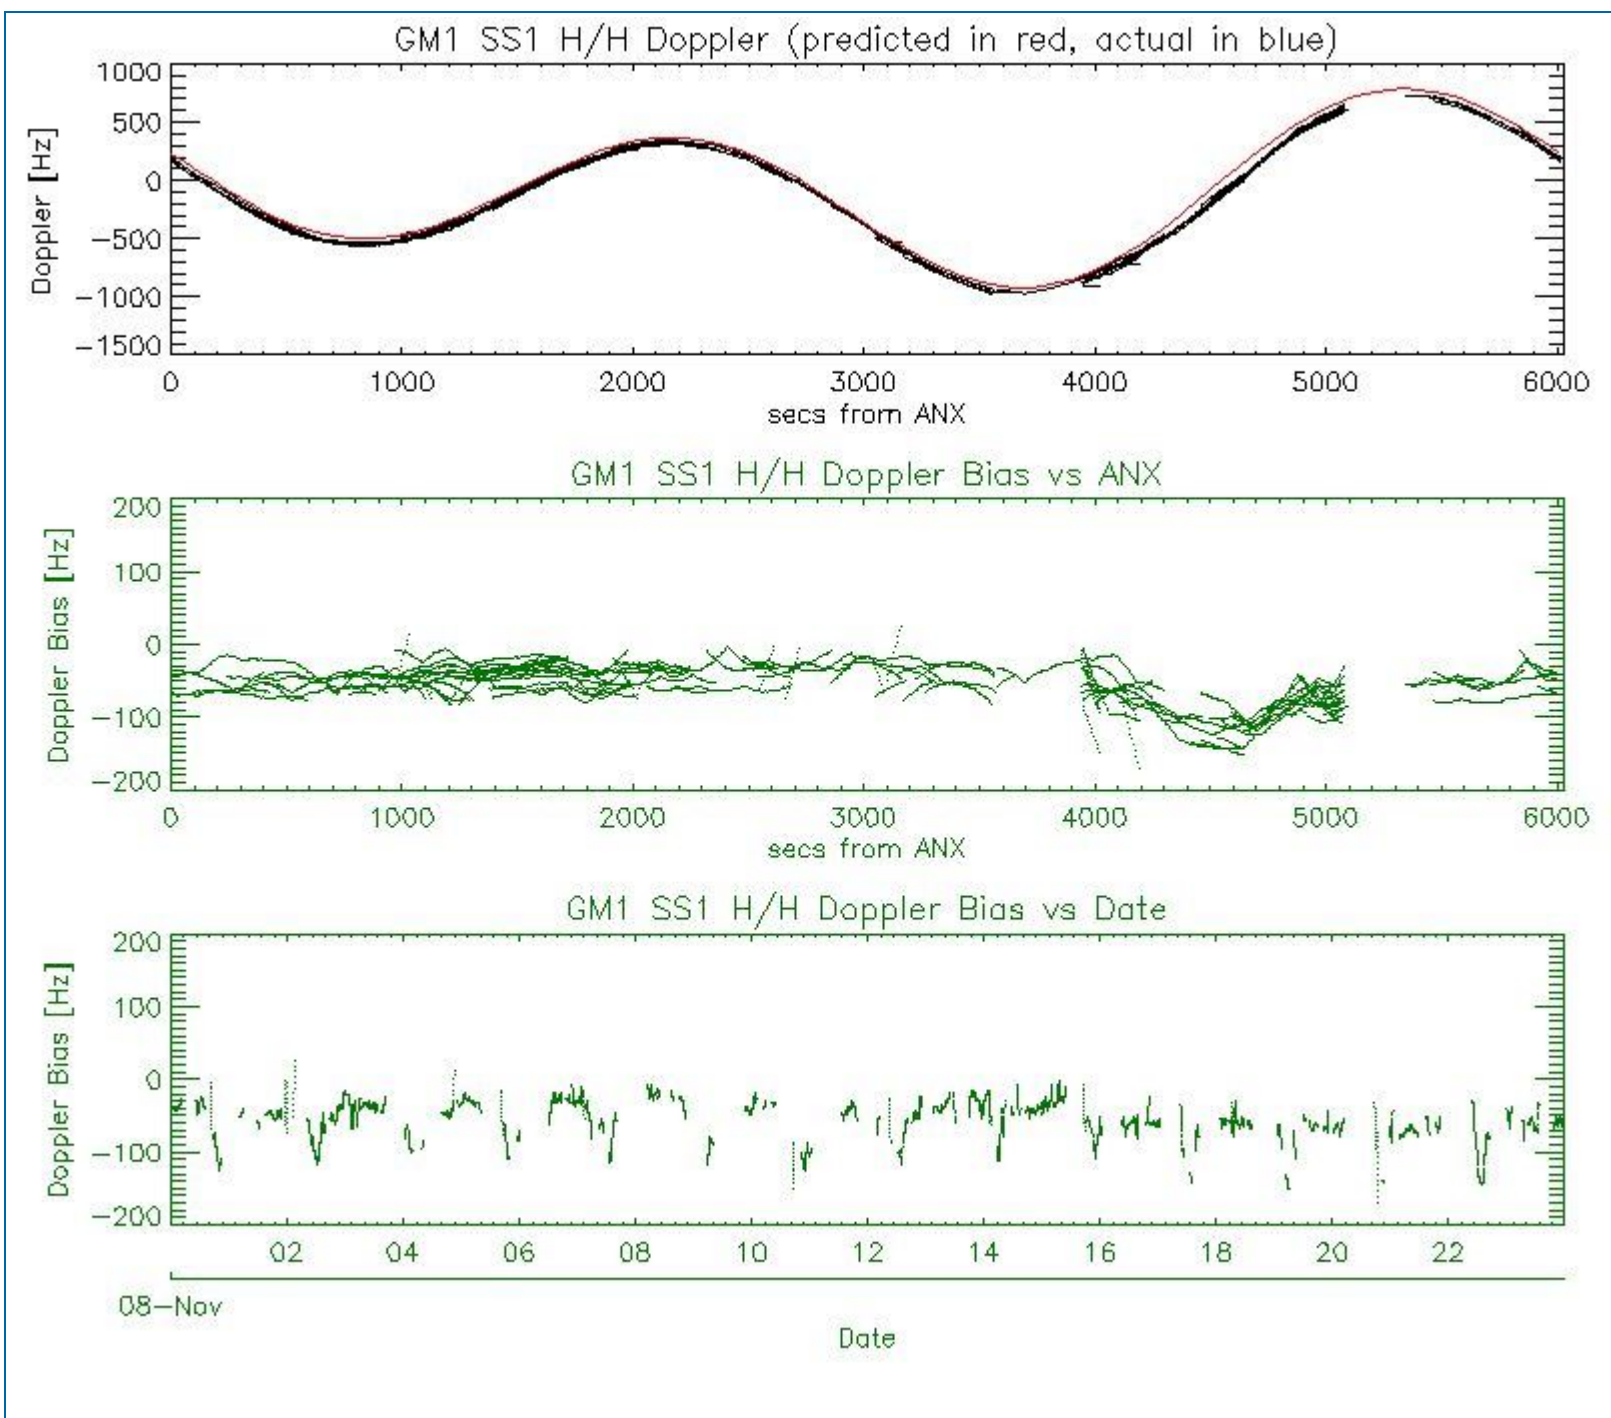

### 5.3 - Doppler JUMPS Analysis for WSM

[ [BACK TO MENU](#) ]



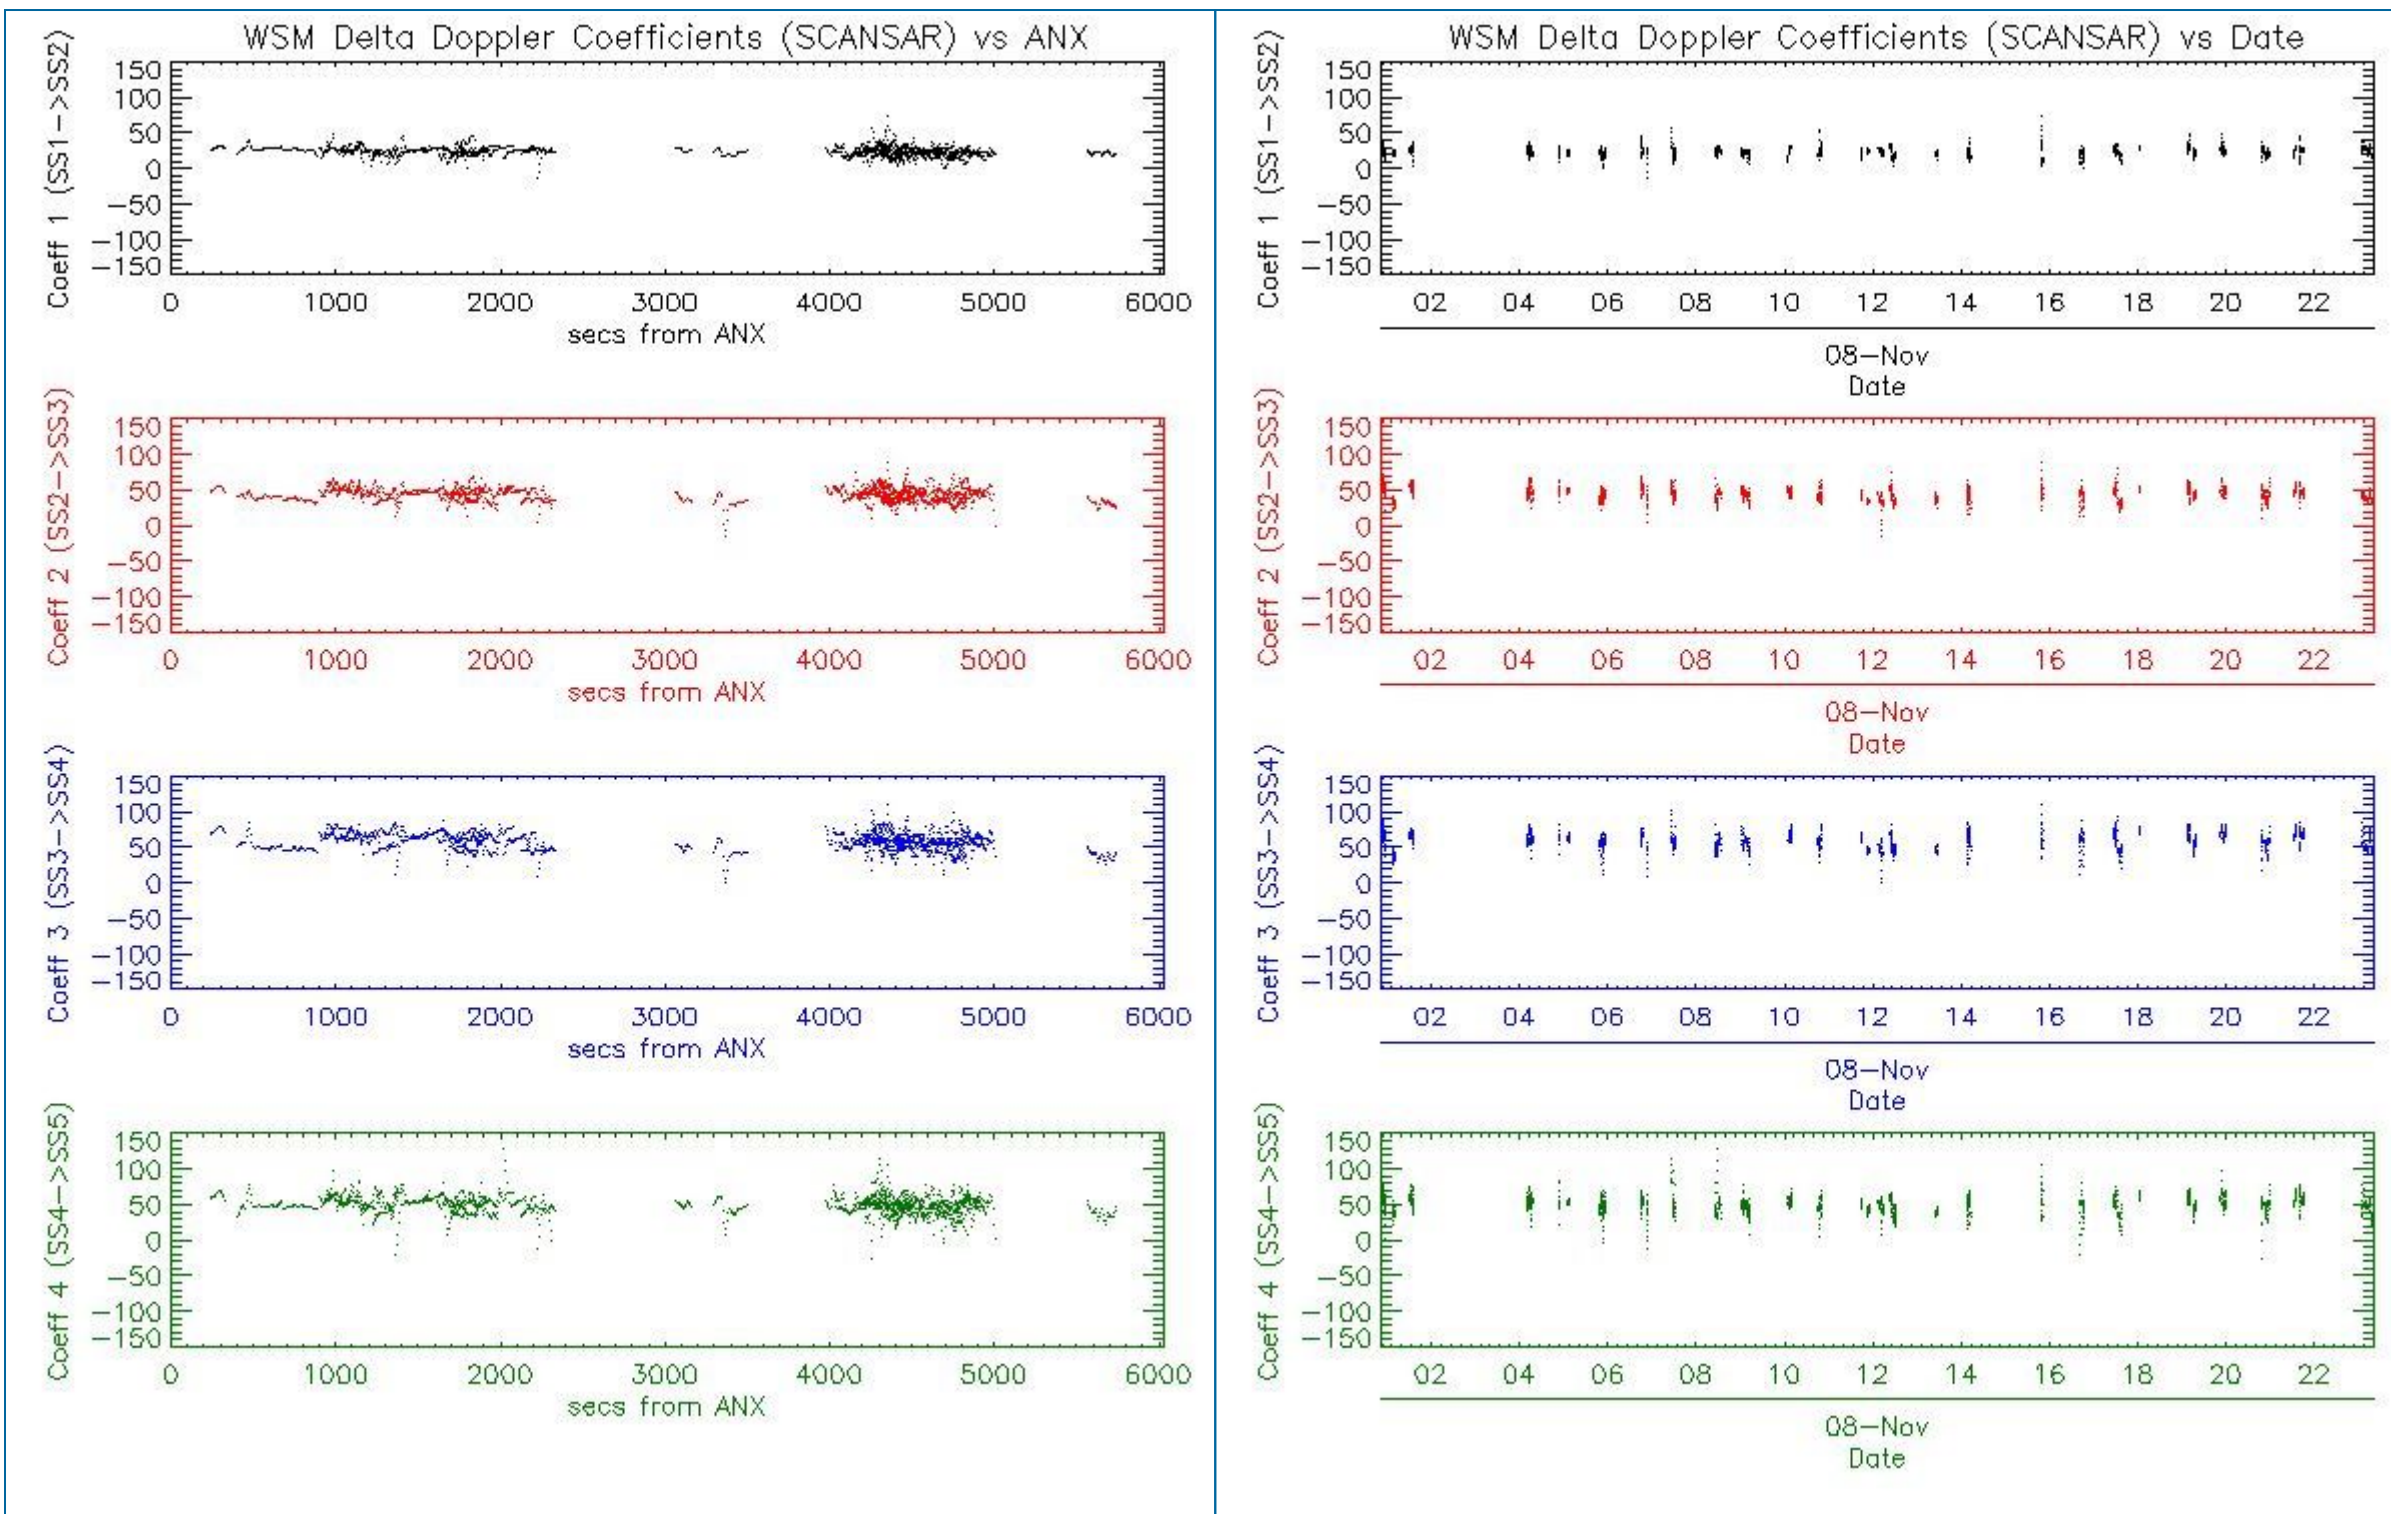



## 6 - CHIRP ANALYSIS

### 6.1 - Analysis for WSM SS1 H/H

#### 6.1.1 - ScaleFactor

[ [BACK TO MENU](#) ]





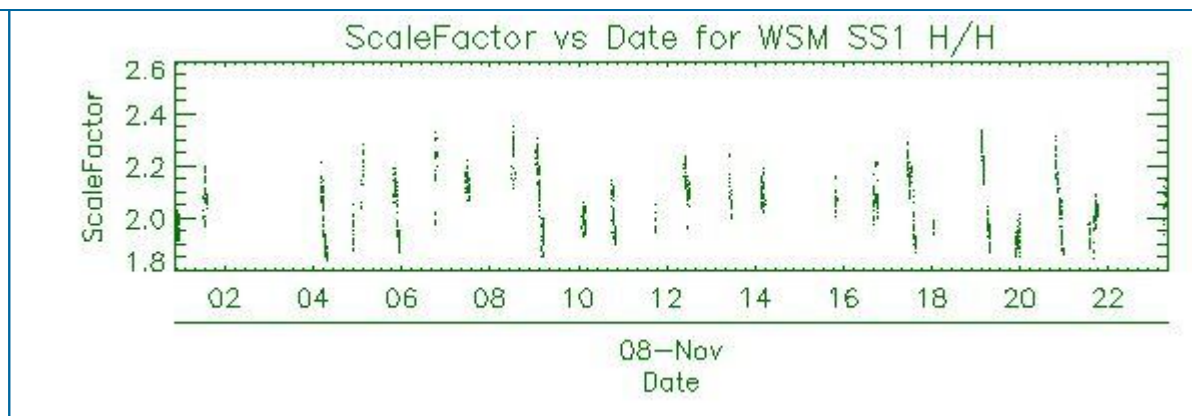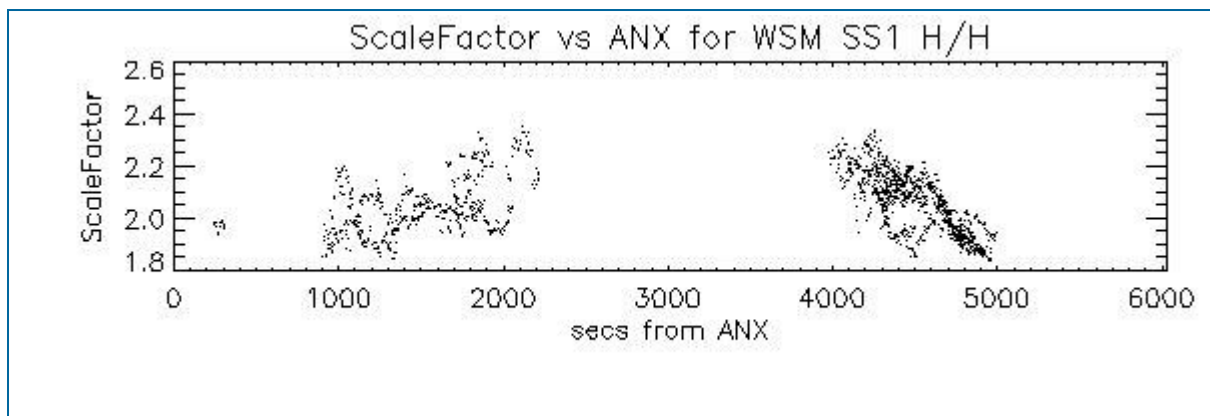

## 6.2 - Analysis for WSM SS1 V/V

### 6.2.1 - ScaleFactor

[ [BACK TO MENU](#) ]

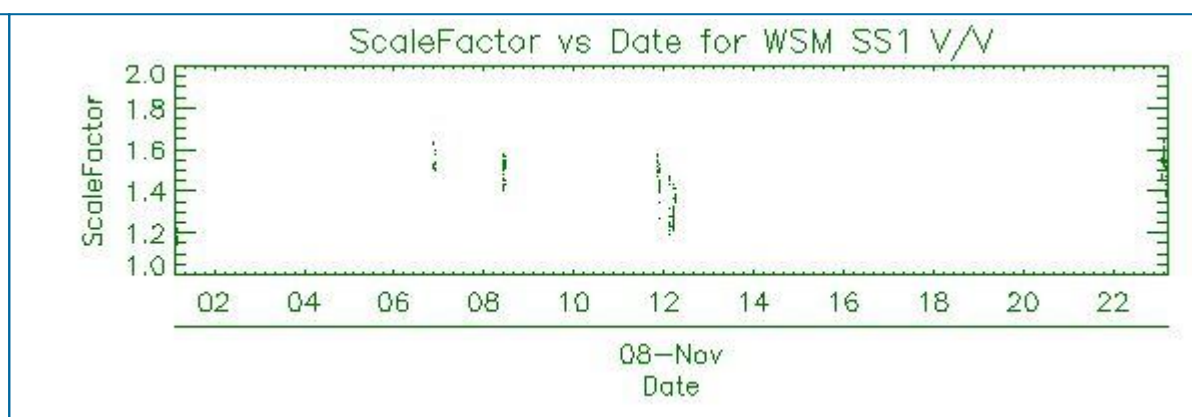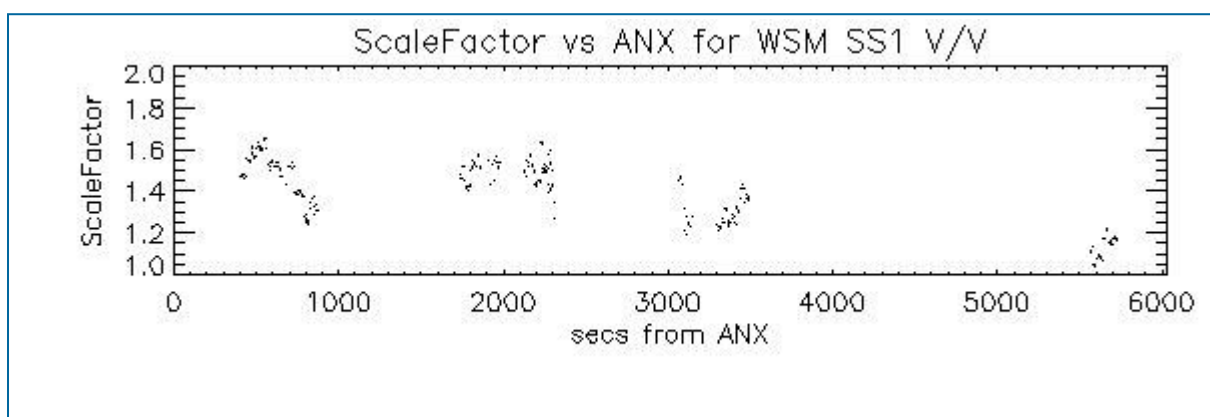




## 7 - RAW DATA ANALYSIS

### 7.1 - Analysis for WVS

[ [BACK TO MENU](#) ]

--	--	--




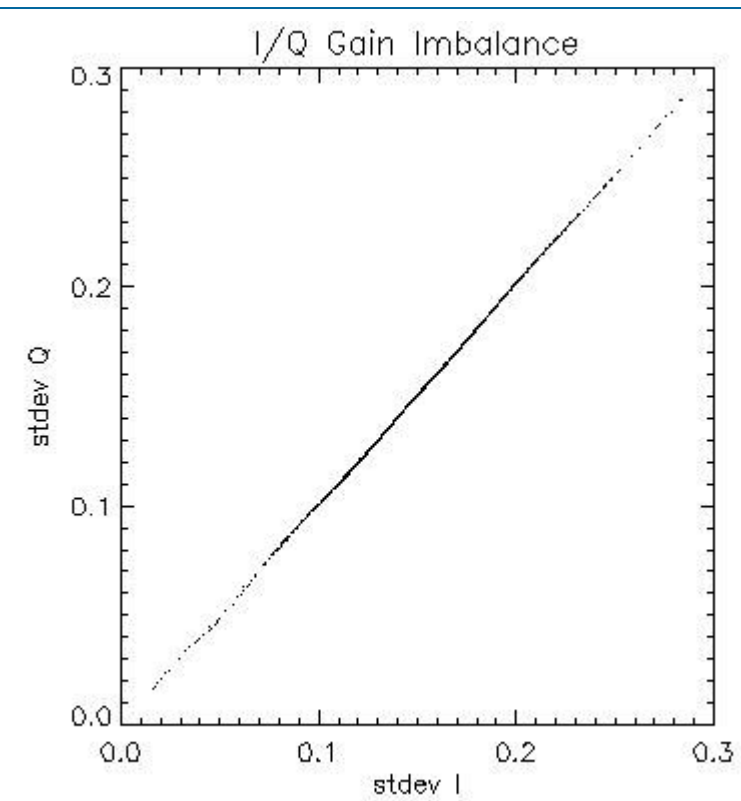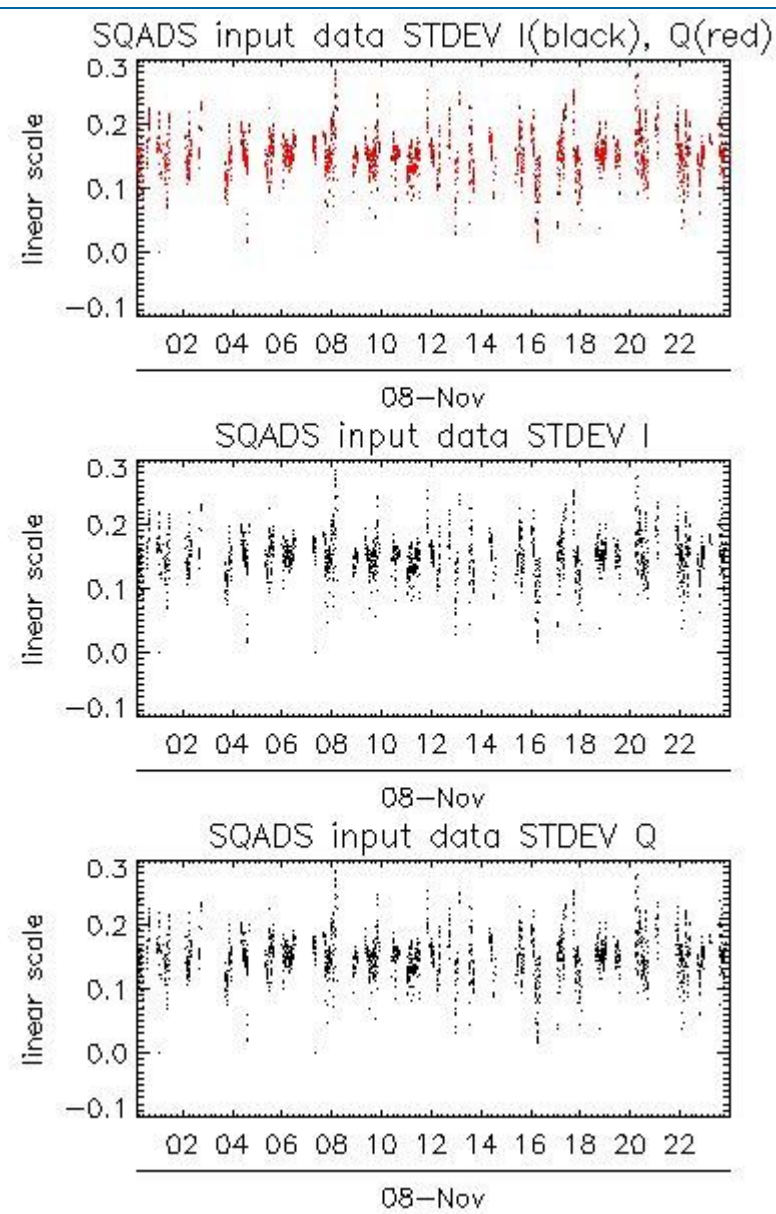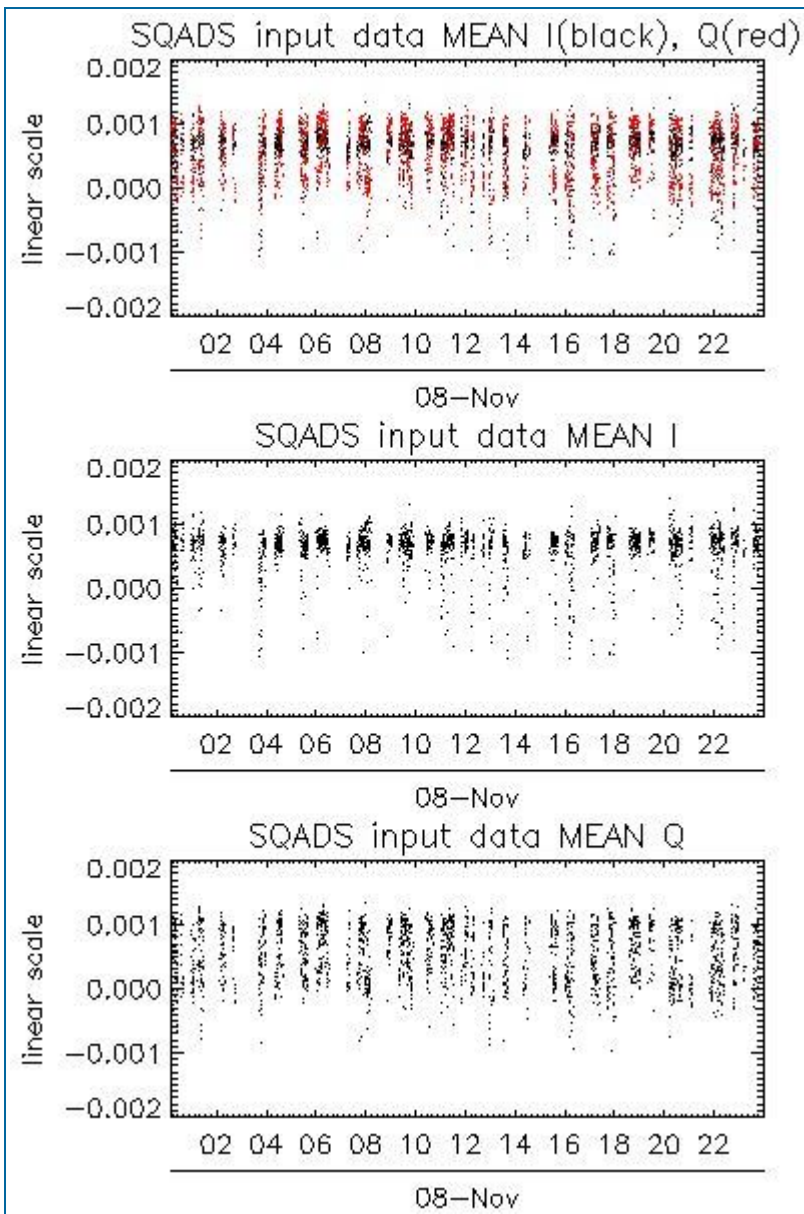


Channel	Statistics	DSS-B
MEAN I	mean	0.000618147
	stdev	1.25851e-07
MEAN Q	mean	0.000535288
	stdev	1.96883e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.150606
	stdev	0.00121344
STDEV Q	mean	0.151180
	stdev	0.00123985

## 7.2 - Analysis for IMM

[ [BACK TO MENU](#) ]



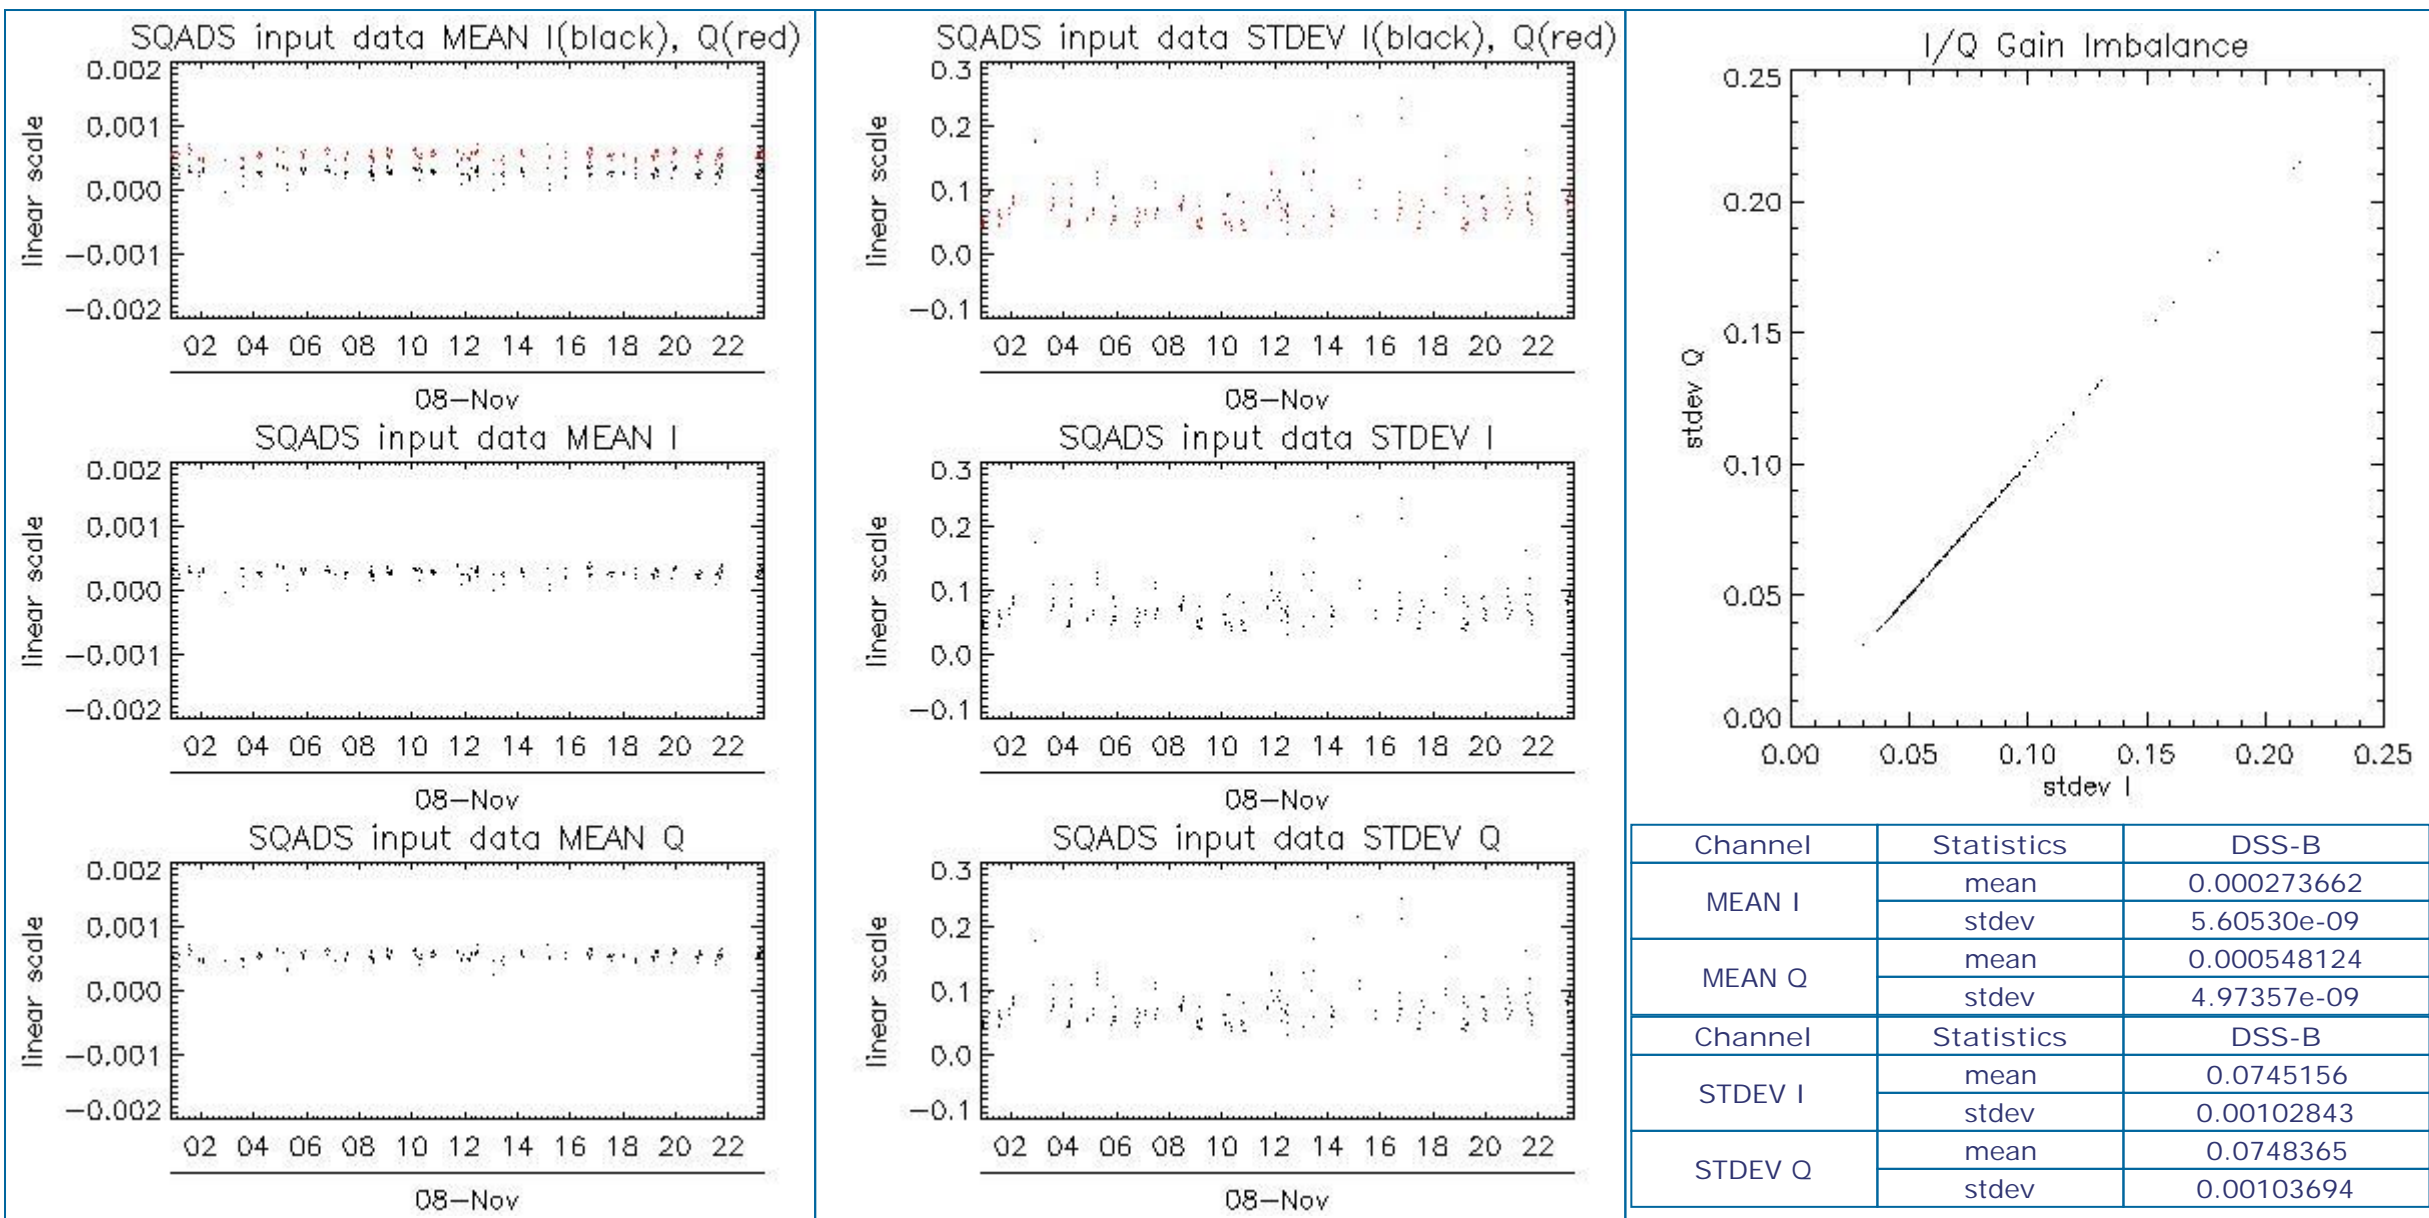



## 8 - TELEMETRY ANALYSIS

Processing Center	Product	Gaps	Missing lines
PDE	ASA_WSM_1PNPDE20101108_065249_000000923096_00164_45437_4409.N1	0	1
PDE	ASA_WSM_1PNPDE20101108_180122_000000923096_00171_45444_4493.N1	0	142

### 8.1 - Number of Missing lines


[ [BACK TO MENU](#) ]



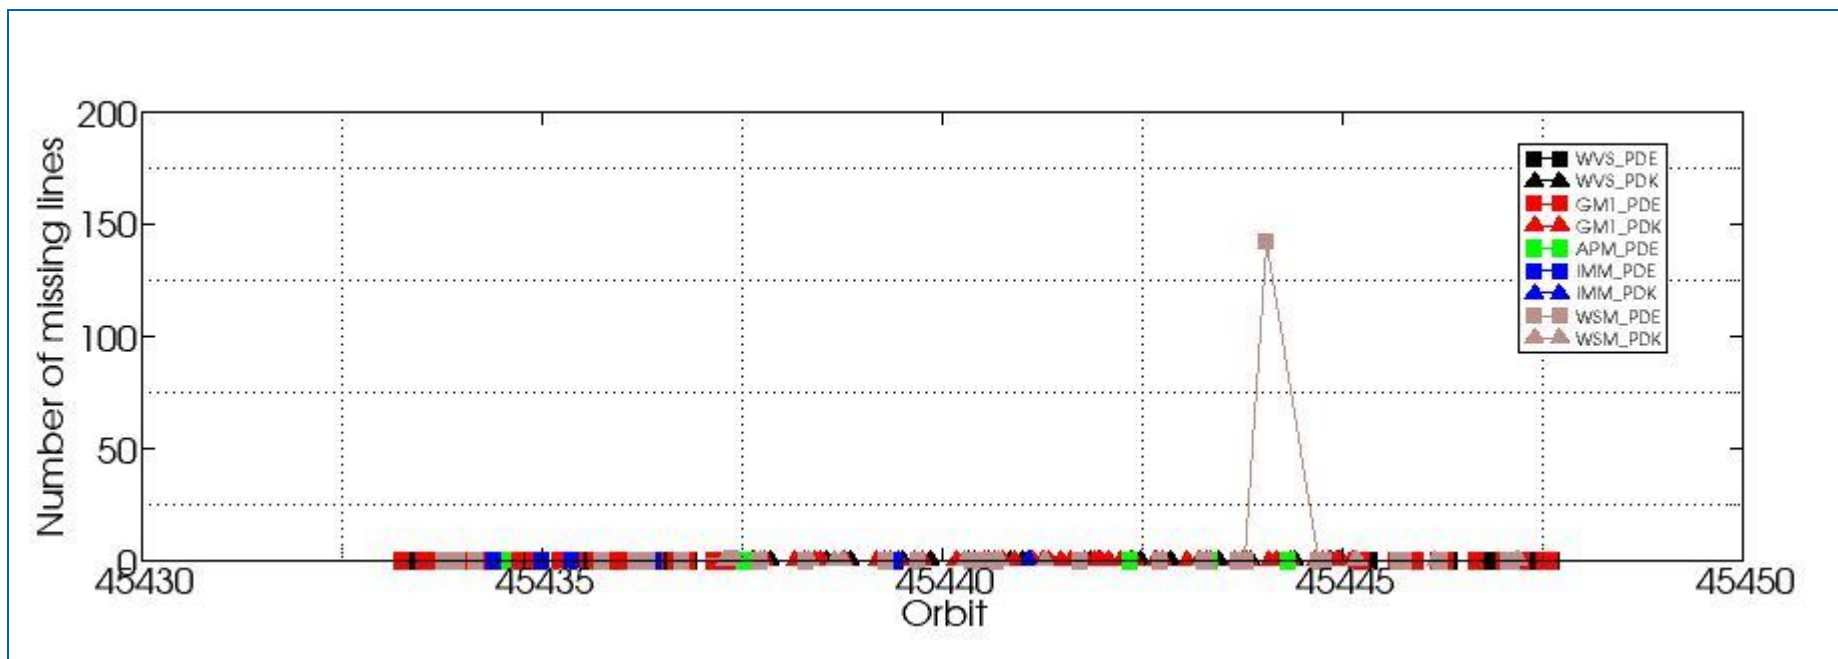

## 8.2 - Number of Gaps

[ [BACK TO MENU](#) ]

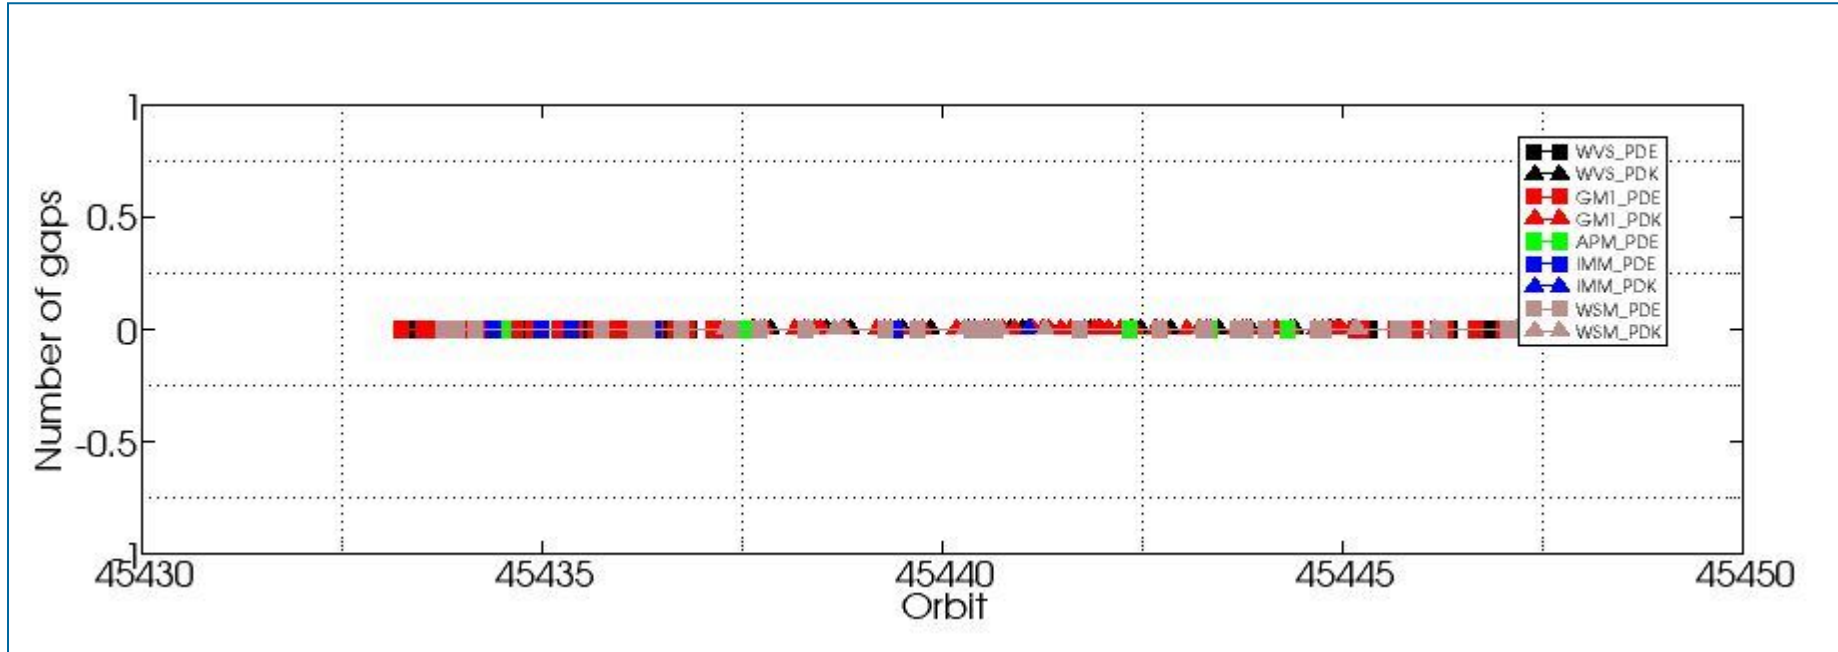

#####  
ASAR DAILY REPORT for 101108  
#####

MODE: DAILY  
ANALYSIS: ALL  
DATE: 2010-11-08 00:00:00

Analysis will be performed from 2010-11-08 00:00:00 to 2010-11-08 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_101108/

DATA SUMMARY  
#####  
Summary will be performed from 2010-11-08 00:00:00 to 2010-11-08 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_101108/DATA\_SUMMARY

Creating directory ./RESULTS/DAILY/\_101108/DATA\_SUMMARY...  
Writing file ./RESULTS/DAILY/\_101108/DATA\_SUMMARY/Data\_summary.html...

\*\*\*\*\*  
Getting WVS products list from 2010-11-08 00:00:00 to 2010-11-08 23:59:59...  
Writing file ./RESULTS/DAILY/\_101108/DATA\_SUMMARY/List\_WVS\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_101108/DATA\_SUMMARY/List\_WVS\_products\_used.txt...

\*\*\*\*\*  
Getting GM1 products list from 2010-11-08 00:00:00 to 2010-11-08 23:59:59...  
Writing file ./RESULTS/DAILY/\_101108/DATA\_SUMMARY/List\_GM1\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_101108/DATA\_SUMMARY/List\_GM1\_products\_used.txt...

\*\*\*\*\*  
Getting APM products list from 2010-11-08 00:00:00 to 2010-11-08 23:59:59...  
Writing file ./RESULTS/DAILY/\_101108/DATA\_SUMMARY/List\_APM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_101108/DATA\_SUMMARY/List\_APM\_products\_used.txt...

\*\*\*\*\*  
Getting IMM products list from 2010-11-08 00:00:00 to 2010-11-08 23:59:59...  
Writing file ./RESULTS/DAILY/\_101108/DATA\_SUMMARY/List\_IMM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_101108/DATA\_SUMMARY/List\_IMM\_products\_used.txt...

\*\*\*\*\*  
Getting WSM products list from 2010-11-08 00:00:00 to 2010-11-08 23:59:59...  
Writing file ./RESULTS/DAILY/\_101108/DATA\_SUMMARY/List\_WSM\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_101108/DATA\_SUMMARY/List\_WSM\_products\_used.txt...

\*\*\*\*\*  
Getting MS products list from 2010-11-08 00:00:00 to 2010-11-08 23:59:59...  
Writing file ./RESULTS/DAILY/\_101108/DATA\_SUMMARY/List\_MS\_products\_used.xls...  
Writing file ./RESULTS/DAILY/\_101108/DATA\_SUMMARY/List\_MS\_products\_used.txt...

DATA SUMMARY completed  
#####

AUXILIARY FILES ANALYSIS  
#####  
Analysis will be performed from 2010-11-08 00:00:00 to 2010-11-08 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_101108/AUXILIARY

Creating directory ./RESULTS/DAILY/\_101108/AUXILIARY...

\*\*\*\*\*  
Looking for the IECF operational ADFs list...



ADF filter 20101108\*current\_3\_IECF\_ADFs.txt  
 Found list 20101108\_030003\_current\_3\_IECF\_ADFs.txt...  
 Extracting ADFs...

ASA\_CON\_AXVIEC20100608\_125449\_20100317\_120410\_20101231\_000000  
 ASA\_INS\_AXVIEC20101028\_095209\_20101022\_000000\_20101231\_235959  
 ASA\_XCH\_AXVIEC20091217\_113006\_20020301\_000000\_20101231\_000000  
 ASA\_XCA\_AXVIEC20100608\_123419\_20100317\_120410\_20110101\_000000

Writing file ./RESULTS/DAILY/\_101108/AUXILIARY/ASAR\_ADFs\_IECF\_List3.html...  
 Writing file ./RESULTS/DAILY/\_101108/AUXILIARY/Auxiliary\_files\_summary.html...

\*\*\*\*\*

Analysing WVS products...

Writing file ./RESULTS/DAILY/\_101108/AUXILIARY/Check\_ADFs\_WVS.xls...  
 Writing file ./RESULTS/DAILY/\_101108/AUXILIARY/Check\_ADFs\_WVS.txt...

ASA_WVS_1PNPDE20101108_001010_000008993096_00160_45433_4337.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_003418_000003303096_00160_45433_4340.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_005924_000002543096_00160_45433_4341.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_010239_000002553096_00160_45433_4353.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_011451_000008243096_00160_45433_4360.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_020754_000007343096_00161_45434_4362.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_023947_000002253096_00161_45434_4379.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_034111_000007793096_00162_45435_4378.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_035356_000002403096_00162_45435_4397.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_042020_000011093096_00162_45435_4399.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_052011_000010193096_00163_45436_4400.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_053656_000002103096_00163_45436_4412.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_060015_000017843096_00163_45436_4418.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_071503_000001953096_00164_45437_4421.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_201106_000018893096_00172_45445_4516.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_210222_000003003096_00172_45445_4534.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_215057_000019193096_00173_45446_4536.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_224236_000003303096_00173_45446_4537.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_224706_000007043096_00173_45446_4550.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_231256_000000753096_00174_45447_4548.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_233336_000008843096_00174_45447_4554.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20101108_235908_000002403096_00174_45447_4557.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_071803_000001653096_00164_45437_9898.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_074029_000018593096_00164_45437_9895.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_085116_000005853096_00165_45438_0095.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_092043_000019193096_00165_45438_0098.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_102519_000009593096_00166_45439_0129.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_110057_000018743096_00166_45439_0148.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_114843_000001503096_00167_45440_0219.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_115721_000005693096_00167_45440_0221.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_121455_000003903096_00167_45440_0224.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_124111_000002403096_00167_45440_0226.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_125610_000004873096_00167_45440_0229.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_130620_000000593096_00168_45441_0231.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_133014_000008093096_00168_45441_0280.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_142125_000003003096_00168_45441_0281.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_143116_000001193096_00168_45441_0285.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_143116_000001193096_00168_45441_0286.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_152440_000010343096_00169_45442_0329.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_160139_000011843096_00169_45442_0331.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_170209_000011993096_00170_45443_0397.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_174154_000011243096_00170_45443_0409.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_183624_000015593096_00171_45444_0441.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_192208_000004503096_00171_45444_0444.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20101108_193300_000001343096_00171_45444_0447.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

\*\*\*\*\*

Writing file ./RESULTS/DAILY/\_101108/AUXILIARY/Check\_ADFs\_GM1.xls...

Writing file ./RESULTS/DAILY/\_101108/AUXILIARY/Check\_ADFs\_GM1.txt...

ASA_GM1_1PNPDE20101108_002548_000001083096_00160_45433_4335.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_002835_000003443096_00160_45433_4339.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_004034_000000783096_00160_45433_4338.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_004316_000005073096_00160_45433_4342.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_011041_000002473096_00160_45433_4354.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_012922_000000783096_00161_45434_4355.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_013625_000010753096_00161_45434_4358.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_015731_000000663096_00161_45434_4357.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_015924_000000663096_00161_45434_4361.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_020640_000000663096_00161_45434_4359.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_022048_000011363096_00161_45434_4363.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_024410_000000963096_00161_45434_4364.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_024554_000004103096_00161_45434_4371.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_024554_000004103096_00161_45434_4372.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_025335_000013353096_00161_45434_4370.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_031656_000009433096_00162_45435_4381.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_033736_000002113096_00162_45435_4380.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_040200_000004653096_00162_45435_4398.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_041827_000001083096_00162_45435_4395.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_043934_000007913096_00163_45436_4394.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_045505_000006283096_00163_45436_4393.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_050810_000003503096_00163_45436_4392.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_051647_000002053096_00163_45436_4401.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_054117_000000783096_00163_45436_4411.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_054400_000002893096_00163_45436_4413.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_055724_000001693096_00163_45436_4414.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_063044_000008043096_00164_45437_4415.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_064745_000003023096_00164_45437_4416.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_065424_000007613096_00164_45437_4417.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_070806_000004163096_00164_45437_4422.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_195413_000001083096_00172_45445_4505.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_200046_000006163096_00172_45445_4512.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_204323_000000783096_00172_45445_4511.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_204608_000000843096_00172_45445_4514.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_205116_000001503096_00172_45445_4513.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_205907_000001633096_00172_45445_4517.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_210035_000001023096_00172_45445_4531.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_210845_000011423096_00172_45445_4532.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_213553_000002293096_00173_45446_4533.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_214714_000002233096_00173_45446_4535.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_222336_000011363096_00173_45446_4538.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_225937_000003083096_00174_45447_4551.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_231628_000001143096_00174_45447_4549.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_232105_000007493096_00174_45447_4547.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_234854_000001323096_00174_45447_4552.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_235232_000003083096_00174_45447_4553.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20101108_235743_000000783096_00174_45447_4555.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_072130_000003083096_00164_45437_9899.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_073220_000004893096_00164_45437_9897.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_081209_000007073096_00165_45438_9892.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_082248_000001143096_00165_45438_0092.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_083716_000001633096_00165_45438_0093.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_084431_000004043096_00165_45438_0094.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_091325_000004343096_00165_45438_0096.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_095326_000006283096_00166_45439_0097.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_100314_000000963096_00166_45439_0125.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_101209_000000963096_00166_45439_0126.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_102046_000002713096_00166_45439_0127.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_104159_000000783096_00166_45439_0128.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_105136_000005613096_00166_45439_0130.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_113300_000006163096_00167_45440_0136.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_114455_000002233096_00167_45440_0220.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

ASA_GM1_1PNPDK20101108_120920_000001203096_00167_45440_0222.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_122213_000000783096_00167_45440_0223.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_123119_000005923096_00167_45440_0225.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_124554_000000723096_00167_45440_0227.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_124718_000005313096_00167_45440_0230.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_130800_000009363096_00168_45441_0232.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_132222_000001503096_00168_45441_0276.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_132836_000000903096_00168_45441_0277.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_134424_000007073096_00168_45441_0278.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_135619_000006773096_00168_45441_0279.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_141317_000004893096_00168_45441_0283.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_142749_000002053096_00168_45441_0282.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_143401_000002293096_00168_45441_0284.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_144329_000010633096_00169_45442_0287.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_150003_000005923096_00169_45442_0325.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_151136_000001203096_00169_45442_0324.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_151520_000005553096_00169_45442_0327.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_154241_000000783096_00169_45442_0326.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_154525_000001933096_00169_45442_0328.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_155114_000006223096_00169_45442_0330.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_162213_000009913096_00170_45443_0332.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_163758_000001023096_00170_45443_0394.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_164714_000001993096_00170_45443_0393.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_165136_000006283096_00170_45443_0395.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_172257_000002473096_00170_45443_0399.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_172257_000002473096_00170_45443_0401.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_172257_000002473096_00170_45443_0402.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_173241_000001143096_00170_45443_0398.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_173241_000001143096_00170_45443_0400.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_173241_000001143096_00170_45443_0403.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_173803_000002293096_00170_45443_0396.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_180411_000007553096_00171_45444_0406.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_181532_000008103096_00171_45444_0437.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_183146_000002773096_00171_45444_0438.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_190310_000002293096_00171_45444_0439.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_191141_000001873096_00171_45444_0440.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_191948_000001323096_00171_45444_0443.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_193013_000001633096_00171_45444_0442.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_193558_000005313096_00171_45444_0445.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20101108_195028_000001203096_00172_45445_0446.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

\*\*\*\*\*

Analysing APM products...

Writing file ./RESULTS/DAILY/\_101108/AUXILIARY/Check\_ADFs\_APM.xls...

Writing file ./RESULTS/DAILY/\_101108/AUXILIARY/Check\_ADFs\_APM.txt...

ASA_APM_1PNPDE20101108_020417_000000423096_00161_45434_4366.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20101108_020537_000000423096_00161_45434_4368.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20101108_070704_000000423096_00164_45437_4410.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20101108_150956_000000773096_00169_45442_4488.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20101108_165033_000000433096_00170_45443_4491.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20101108_182859_000001503096_00171_45444_4495.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

\*\*\*\*\*

Analysing IMM products...

Writing file ./RESULTS/DAILY/\_101108/AUXILIARY/Check\_ADFs\_IMM.xls...

Writing file ./RESULTS/DAILY/\_101108/AUXILIARY/Check\_ADFs\_IMM.txt...

ASA_IMM_1PNPDE20101108_015432_000000993096_00161_45434_4365.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20101108_025246_000000383096_00161_45434_4367.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20101108_033239_000002853096_00162_45435_4352.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20101108_051400_000001553096_00163_45436_4387.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK



```

ASA_IMM_1PNPDE20101108_101719_000002003096_00166_45439_4442.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20101108_130452_000000823096_00168_45441_0237.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20101108_213205_000000373096_00173_45446_0515.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

```

\*\*\*\*\*

Analysing WSM products...

Writing file ./RESULTS/DAILY/\_101108/AUXILIARY/Check\_ADFs\_WSM.xls...

Writing file ./RESULTS/DAILY/\_101108/AUXILIARY/Check\_ADFs\_WSM.txt...

```

ASA_WSM_1PNPDE20101108_005150_000003923096_00160_45433_4348.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_010731_000001843096_00160_45433_4350.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_013050_000003303096_00161_45434_4356.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_040950_000005143096_00162_45435_4391.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_045250_000001283096_00163_45436_4396.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_050537_000001353096_00163_45436_4386.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_054850_000005143096_00163_45436_4428.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_065249_000000923096_00164_45437_4409.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_072643_000001103096_00164_45437_4429.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_082450_000001533096_00165_45438_4434.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_100458_000003553096_00166_45439_4441.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_104459_000003923096_00166_45439_4448.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_115149_000002143096_00167_45440_4457.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_120730_000001043096_00167_45440_4458.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_121124_000002143096_00167_45440_4459.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_122339_000002143096_00167_45440_4460.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_140738_000003303096_00168_45441_4485.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_154839_000001473096_00169_45442_4486.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_164439_000001533096_00170_45443_4489.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_172707_000003123096_00170_45443_4492.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_173441_000001903096_00170_45443_4490.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_180122_000000923096_00171_45444_4493.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_190705_000002693096_00171_45444_4496.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_191449_000003003096_00171_45444_4494.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_204743_000002143096_00172_45445_4523.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_205350_000003123096_00172_45445_4524.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_213949_000004343096_00173_45446_4539.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_230447_000002753096_00174_45447_4544.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20101108_230926_000002083096_00174_45447_4545.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_064411_000002083096_00164_45437_9900.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_072843_000002083096_00164_45437_9893.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_072843_000002083096_00164_45437_9894.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_082750_000000923096_00165_45438_0004.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_082939_000002143096_00165_45438_0005.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_090213_000003923096_00165_45438_0105.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_090950_000002083096_00165_45438_0104.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_114318_000000923096_00167_45440_0134.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_122739_000002143096_00167_45440_0233.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_132459_000002083096_00168_45441_0240.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_163951_000002083096_00170_45443_0339.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_195237_000000923096_00172_45445_0448.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_195237_000000923096_00172_45445_0449.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_195606_000002753096_00172_45445_0456.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_213307_000001533096_00173_45446_0516.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_231451_000000923096_00174_45447_0544.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20101108_231831_000001533096_00174_45447_0545.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

```

AUXILIARY FILES ANALYSIS completed

#####

MODULE STEPPING ANALYSIS

#####





Analysis will be performed from 2010-11-08 00:00:00 to 2010-11-08 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_101108/MODULE\_STEPPING

Creating directory ./RESULTS/DAILY/\_101108/MODULE\_STEPPING...  
Creating directory ./RESULTS/DAILY/\_101108/MODULE\_STEPPING/FIRST\_REFERENCE...  
Creating directory ./RESULTS/DAILY/\_101108/MODULE\_STEPPING/SECOND\_REFERENCE...  
Creating directory ./RESULTS/DAILY/\_101108/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE...  
Deleting old files...

\*\*\*\*\*  
\*\*\*\*\*

Creating images comparing with second reference...

Exporting results to the directory ../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/SECOND\_REFERENCE...

Polarization: H  
Reference product: ASA\_MS\_\_0PNPK20010209\_135042\_0000009A024\_00180\_11700\_0052.N1  
Test product: ASA\_MS\_\_0PNPK20101108\_154407\_000000163096\_00169\_45442\_0274.N1

H  
H  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/SECOND\_REFERENCE/TGH\_20101108\_154407-20010209\_135042.png  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/SECOND\_REFERENCE/TPH\_20101108\_154407-20010209\_135042.png  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/SECOND\_REFERENCE/RGH\_20101108\_154407-20010209\_135042.png  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/SECOND\_REFERENCE/RPH\_20101108\_154407-20010209\_135042.png

Polarization: V  
Reference product: ASA\_MS\_\_0PNPK20010209\_140823\_0000009A024\_00180\_11700\_0054.N1  
Test product: ASA\_MS\_\_0PNPDE20101108\_204449\_000000163096\_00172\_45445\_0053.N1

V  
V  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/SECOND\_REFERENCE/TGV\_20101108\_204449-20010209\_140823.png  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/SECOND\_REFERENCE/TPV\_20101108\_204449-20010209\_140823.png  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/SECOND\_REFERENCE/RGV\_20101108\_204449-20010209\_140823.png  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/SECOND\_REFERENCE/RPV\_20101108\_204449-20010209\_140823.png

\*\*\*\*\*  
\*\*\*\*\*

Creating images comparing with previous product reference...

Exporting results to the directory ../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE...

Polarization: H  
Reference product: ASA\_MS\_\_0PNPDE20101108\_054243\_000000163096\_00163\_45436\_0052.N1  
Test product: ASA\_MS\_\_0PNPK20101108\_154407\_000000163096\_00169\_45442\_0274.N1

H  
H  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TGH\_20101108\_154407-20101108\_054243.png  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TPH\_20101108\_154407-20101108\_054243.png  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RGH\_20101108\_154407-20101108\_054243.png  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RPH\_20101108\_154407-20101108\_054243.png

Polarization: V  
Reference product: ASA\_MS\_\_0PNPK20101108\_104325\_000000163096\_00166\_45439\_0273.N1  
Test product: ASA\_MS\_\_0PNPDE20101108\_204449\_000000163096\_00172\_45445\_0053.N1

V  
V  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TGV\_20101108\_204449-20101108\_104325.png  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/TPV\_20101108\_204449-20101108\_104325.png  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RGV\_20101108\_204449-20101108\_104325.png  
../../RESULTS/DAILY/\_101108/MODULE\_STEPPING/PREVIOUS\_PRODUCT\_REFERENCE/RPV\_20101108\_204449-20101108\_104325.png

MODULE\_STEPPING ANALYSIS completed  
#####

#####

Creating directory ./RESULTS/DAILY/\_101108/CALIBRATION\_PULSES...

\*\*\*\*\*  
\*\*\*\*\*

ALL ROWS Analysis will be performed from 2010-11-08 00:00:00 to 2010-11-08 23:59:59

Analysing products WVS IS2 V/V

Writing image ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Calibration\_pulses\_all\_rows\_WVS\_IS2\_VV.png...

Analysing products GM1 SS3 H/H

Writing image ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Calibration\_pulses\_all\_rows\_GM1\_SS3\_HH.png...

\*\*\*\*\*  
\*\*\*\*\*

TEMPORAL EVOLUTION Analysis will be performed from 2010-11-08 00:00:00 to 2010-11-08 23:59:59

Analysing products WVS IS2 V/V

Getting calibration pulses data for WVS IS2 V/V from 2010-11-08 00:00:00 to 2010-11-08 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/\_101108/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2010-11-08\_1.dat...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_1.png...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2010-11-08 00:00:00 to 2010-11-08 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/\_101108/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2010-11-08\_2.dat...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_2.png...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2010-11-08 00:00:00 to 2010-11-08 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/\_101108/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2010-11-08\_3.dat...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_3.png...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2010-11-08 00:00:00 to 2010-11-08 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/\_101108/CALIBRATION\_PULSES/Calibration\_pulses\_data\_WVS\_IS2\_VV\_2010-11-08\_4.dat...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_WVS\_IS2\_VV\_4.png...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Transmit\_Power\_WVS\_IS2\_VV\_4.png...

Analysing products GM1 SS3 H/H

Getting calibration pulses data for GM1 SS3 H/H from 2010-11-08 00:00:00 to 2010-11-08 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/\_101108/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2010-11-08\_1.dat...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_1.png...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_1.png...

Getting calibration pulses data for GM1 SS3 H/H from 2010-11-08 00:00:00 to 2010-11-08 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/\_101108/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2010-11-08\_2.dat...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_2.png...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2010-11-08 00:00:00 to 2010-11-08 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/\_101108/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2010-11-08\_3.dat...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_3.png...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2010-11-08 00:00:00 to 2010-11-08 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/\_101108/CALIBRATION\_PULSES/Calibration\_pulses\_data\_GM1\_SS3\_HH\_2010-11-08\_4.dat...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Average\_P1\_P1a\_P2\_P3\_GM1\_SS3\_HH\_4.png...

Writing ../../RESULTS/DAILY/\_101108//CALIBRATION\_PULSES/Transmit\_Power\_GM1\_SS3\_HH\_4.png...

CALIBRATION PULSES ANALYSIS completed

#####

DOPPLER ANALYSIS

#####

Creating directory ./RESULTS/DAILY/\_101108/DOPPLER...

\*\*\*\*\*  
\*\*\*\*\*

DOPPLER ANX Analysis will be performed from 2010-11-08 00:00:00 to 2010-11-08 23:59:59

Analysing products WVS IS2 V/V

Getting doppler data for WVS IS2 V/V from 2010-11-08 00:00:00 to 2010-11-08 23:59:59...

Writing file ./RESULTS/DAILY/\_101108/DOPPLER/Doppler\_data\_WVS\_IS2\_VV\_2010-11-08.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/\_101108/DOPPLER/DOPPLER\_ANX\_WVS\_IS2\_VV.png...

Analysing products GM1 SS1 H/H

Getting doppler data for GM1 SS1 H/H from 2010-11-08 00:00:00 to 2010-11-08 23:59:59...

Writing file ./RESULTS/DAILY/\_101108/DOPPLER/Doppler\_data\_GM1\_SS1\_HH\_2010-11-08.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/\_101108/DOPPLER/DOPPLER\_ANX\_GM1\_SS1\_HH.png...

\*\*\*\*\*  
\*\*\*\*\*

DOPPLER JUMPS Analysis will be performed on WSM products from 2010-11-08 00:00:00 to 2010-11-08 23:59:59

Analysing by default products WSM

Getting doppler jumps data for WSM from 2010-11-08 00:00:00 to 2010-11-08 23:59:59...

Writing file ./RESULTS/DAILY/\_101108/DOPPLER/Doppler\_Jumps\_data\_WSM\_2010-11-08.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/\_101108/DOPPLER/DOPPLER\_JUMPS\_ANX\_WSM.png...

Writing file ../../RESULTS/DAILY/\_101108/DOPPLER/DOPPLER\_JUMPS\_Date\_WSM.png...

\*\*\*\*\*  
\*\*\*\*\*

DOPPLER MAP Analysis will be performed from 2010-11-08 00:00:00 to 2010-11-08 23:59:59

Analysing products WVS IS2 V/V

Loading predicted doppler values....

Phase: descending

Found data...

Computing mean error doppler estimated-predicted...

Mean error = -72.654382 Hz

Writing file ../../RESULTS/DAILY/\_101108//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_WVS\_IS2\_VV\_desc.jpg...

Writing file ../../RESULTS/DAILY/\_101108//DOPPLER/DOPPLER\_Absolute\_WVS\_IS2\_VV\_desc.jpg...

\*\*\*\*\*

Loading predicted doppler values....

Phase: ascending

Found data...

Computing mean error doppler estimated-predicted...

Mean error = -63.151488 Hz

Writing file ../../RESULTS/DAILY/\_101108//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_WVS\_IS2\_VV\_asc.jpg...

Writing file ../../RESULTS/DAILY/\_101108//DOPPLER/DOPPLER\_Absolute\_WVS\_IS2\_VV\_asc.jpg...

\*\*\*\*\*

Analysing products GM1 SS1 H/H

Loading predicted doppler values....

Phase: descending  
Found data...  
Computing mean error doppler estimated-predicted...  
Mean error = -50.126377 Hz  
Writing file ../../RESULTS/DAILY/\_101108//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_GM1\_SS1\_HH\_desc.jpg...  
Writing file ../../RESULTS/DAILY/\_101108//DOPPLER/DOPPLER\_Absolute\_GM1\_SS1\_HH\_desc.jpg...

\*\*\*\*\*  
Loading predicted doppler values....  
Phase: ascending  
Found data...  
Computing mean error doppler estimated-predicted...  
Mean error = -61.461803 Hz  
Writing file ../../RESULTS/DAILY/\_101108//DOPPLER/DOPPLER\_Estimated-Predicted-MeanError\_GM1\_SS1\_HH\_asc.jpg...  
Writing file ../../RESULTS/DAILY/\_101108//DOPPLER/DOPPLER\_Absolute\_GM1\_SS1\_HH\_asc.jpg...

\*\*\*\*\*

DOPPLER ANALYSIS completed  
#####

CHIRP ANALYSIS  
#####  
Creating directory ./RESULTS/DAILY/\_101108/CHIRP...

\*\*\*\*\*  
\*\*\*\*\*  
CHIRP Analysis will be performed from 2010-11-08 00:00:00 to 2010-11-08 23:59:59

Analysing products WSM SS1 H/H  
\*\*\*\*\*  
Getting ScaleFactor data for WSM SS1 H/H from 2010-11-08 00:00:00 to 2010-11-08 23:59:59...  
Writing file ./RESULTS/DAILY/\_101108/CHIRP/ScaleFactor\_data\_WSM\_SS1\_HH\_2010-11-08.dat...  
Running IDL program...  
Writing file ../../RESULTS/DAILY/\_101108/CHIRP/ScaleFactor\_ANX\_WSM\_SS1\_HH.png...  
Writing file ../../RESULTS/DAILY/\_101108/CHIRP/ScaleFactor\_DATE\_WSM\_SS1\_HH.png...

Analysing products WSM SS1 V/V  
\*\*\*\*\*  
Getting ScaleFactor data for WSM SS1 V/V from 2010-11-08 00:00:00 to 2010-11-08 23:59:59...  
Writing file ./RESULTS/DAILY/\_101108/CHIRP/ScaleFactor\_data\_WSM\_SS1\_VV\_2010-11-08.dat...  
Running IDL program...  
Writing file ../../RESULTS/DAILY/\_101108/CHIRP/ScaleFactor\_ANX\_WSM\_SS1\_VV.png...  
Writing file ../../RESULTS/DAILY/\_101108/CHIRP/ScaleFactor\_DATE\_WSM\_SS1\_VV.png...

CHIRP ANALYSIS completed  
#####

RAW DATA ANALYSIS  
#####  
Analysis will be performed from 2010-11-08 00:00:00 to 2010-11-08 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_101108/RAW\_DATA

Creating directory ./RESULTS/DAILY/\_101108/RAW\_DATA...

\*\*\*\*\*  
Getting raw data for WVS from 2010-11-08 00:00:00 to 2010-11-08 23:59:59...  
Writing file ./RESULTS/DAILY/\_101108/RAW\_DATA/Raw\_data\_WVS\_2010-11-08.dat...

Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/\_101108/RAW\_DATA/Raw\_data\_WVS\_input\_mean.png...  
Creating image ../../RESULTS/DAILY/\_101108/RAW\_DATA/Raw\_data\_WVS\_input\_stdev.png...  
Creating image ../../RESULTS/DAILY/\_101108/RAW\_DATA/Raw\_data\_WVS\_gain\_imbalance.png...

\*\*\*\*\*  
Getting raw data for IMM from 2010-11-08 00:00:00 to 2010-11-08 23:59:59...  
Writing file ./RESULTS/DAILY/\_101108/RAW\_DATA/Raw\_data\_IMM\_2010-11-08.dat...  
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/\_101108/RAW\_DATA/Raw\_data\_IMM\_input\_mean.png...  
Creating image ../../RESULTS/DAILY/\_101108/RAW\_DATA/Raw\_data\_IMM\_input\_stdev.png...  
Creating image ../../RESULTS/DAILY/\_101108/RAW\_DATA/Raw\_data\_IMM\_gain\_imbalance.png...

RAW DATA ANALYSIS completed  
#####

TELEMETRY ANALYSIS  
#####  
Analysis will be performed from 2010-11-08 00:00:00 to 2010-11-08 23:59:59  
Results will be exported to the directory: ./RESULTS/DAILY/\_101108/TELEMETRY

Creating directory ./RESULTS/DAILY/\_101108/TELEMETRY...

Looking for gaps and missing lines in WVS products...  
\*\*\*\*\*  
Checking 22 products from PDE...  
Checking 23 products from PDK...

Looking for gaps and missing lines in GM1 products...  
\*\*\*\*\*  
Checking 48 products from PDE...  
Checking 55 products from PDK...

Looking for gaps and missing lines in APM products...  
\*\*\*\*\*  
Checking 6 products from PDE...  
No products from PDK...

Looking for gaps and missing lines in IMM products...  
\*\*\*\*\*  
Checking 5 products from PDE...  
Checking 2 products from PDK...

Looking for gaps and missing lines in WSM products...  
\*\*\*\*\*  
Checking 29 products from PDE...  
Found product...ASA\_WSM\_1PNPDE20101108\_065249\_00000923096\_00164\_45437\_4409.N1 / 0 gaps / 1 missing lines  
Found product...ASA\_WSM\_1PNPDE20101108\_180122\_00000923096\_00171\_45444\_4493.N1 / 0 gaps / 142 missing lines  
Checking 17 products from PDK...

Creating graph of missing lines and gaps...  
\*\*\*\*\*  
Creating image: ./RESULTS/DAILY/\_101108/TELEMETRY/TELEMETRY\_Missing\_lines.png...  
Creating image: ./RESULTS/DAILY/\_101108/TELEMETRY/TELEMETRY\_Gaps.png...

TELEMETRY ANALYSIS completed  
#####

HTML REPORT generation  
#####

Building file ./RESULTS/DAILY/\_101108/asarReport.html...  
Building DATA SUMMARY section...  
Building AUXILIARY FILES ANALYSIS section...  
Building MODULE STEPPING ANALYSIS section...  
Building CALIBRATION PULSES ANALYSIS section...  
Building DOPPLER ANALYSIS section...  
Building CHIRP ANALYSIS section...  
Building RAW DATA ANALYSIS section...  
Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed  
#####



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20101108_020417_000000423096_00161_45434_4366.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20101108_020537_000000423096_00161_45434_4368.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20101108_070704_000000423096_00164_45437_4410.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20101108_150956_000000773096_00169_45442_4488.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20101108_165033_000000433096_00170_45443_4491.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20101108_182859_000001503096_00171_45444_4495.N1	OK	OK	OK	OK



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20101108_002548_000001083096_00160_45433_4335.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_002835_000003443096_00160_45433_4339.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_004034_000000783096_00160_45433_4338.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_004316_000005073096_00160_45433_4342.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_011041_000002473096_00160_45433_4354.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_012922_000000783096_00161_45434_4355.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_013625_000010753096_00161_45434_4358.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_015731_000000663096_00161_45434_4357.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_015924_000000663096_00161_45434_4361.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_020640_000000663096_00161_45434_4359.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_022048_000011363096_00161_45434_4363.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_024410_000000963096_00161_45434_4364.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_024554_000004103096_00161_45434_4371.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_024554_000004103096_00161_45434_4372.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_025335_000013353096_00161_45434_4370.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_031656_000009433096_00162_45435_4381.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_033736_000002113096_00162_45435_4380.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_040200_000004653096_00162_45435_4398.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_041827_000001083096_00162_45435_4395.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_043934_000007913096_00163_45436_4394.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_045505_000006283096_00163_45436_4393.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_050810_000003503096_00163_45436_4392.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_051647_000002053096_00163_45436_4401.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_054117_000000783096_00163_45436_4411.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_054400_000002893096_00163_45436_4413.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_055724_000001693096_00163_45436_4414.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_063044_000008043096_00164_45437_4415.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_064745_000003023096_00164_45437_4416.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_065424_000007613096_00164_45437_4417.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_070806_000004163096_00164_45437_4422.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_195413_000001083096_00172_45445_4505.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_200046_000006163096_00172_45445_4512.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_204323_000000783096_00172_45445_4511.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_204608_000000843096_00172_45445_4514.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_205116_000001503096_00172_45445_4513.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_205907_000001633096_00172_45445_4517.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_210035_000001023096_00172_45445_4531.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_210845_000011423096_00172_45445_4532.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_213553_000002293096_00173_45446_4533.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_214714_000002233096_00173_45446_4535.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_222336_000011363096_00173_45446_4538.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_225937_000003083096_00174_45447_4551.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_231628_000001143096_00174_45447_4549.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_232105_000007493096_00174_45447_4547.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_234854_000001323096_00174_45447_4552.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_235232_000003083096_00174_45447_4553.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20101108_235743_000000783096_00174_45447_4555.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_072130_000003083096_00164_45437_9899.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_073220_000004893096_00164_45437_9897.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_081209_000007073096_00165_45438_9892.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_082248_000001143096_00165_45438_0092.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_083716_000001633096_00165_45438_0093.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_084431_000004043096_00165_45438_0094.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_091325_000004343096_00165_45438_0096.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_095326_000006283096_00166_45439_0097.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_100314_000000963096_00166_45439_0125.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_101209_000000963096_00166_45439_0126.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_102046_000002713096_00166_45439_0127.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_104159_000000783096_00166_45439_0128.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_105136_000005613096_00166_45439_0130.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_113300_000006163096_00167_45440_0136.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_114455_000002233096_00167_45440_0220.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_120920_000001203096_00167_45440_0222.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_122213_000000783096_00167_45440_0223.N1					OK	OK	OK	OK

ASA_GM1_1PNPDK20101108_123119_000005923096_00167_45440_0225.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_124554_000000723096_00167_45440_0227.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_124718_000005313096_00167_45440_0230.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_130800_000009363096_00168_45441_0232.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_132222_000001503096_00168_45441_0276.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_132836_000000903096_00168_45441_0277.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_134424_000007073096_00168_45441_0278.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_135619_000006773096_00168_45441_0279.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_141317_000004893096_00168_45441_0283.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_142749_000002053096_00168_45441_0282.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_143401_000002293096_00168_45441_0284.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_144329_000010633096_00169_45442_0287.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_150003_000005923096_00169_45442_0325.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_151136_000001203096_00169_45442_0324.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_151520_000005553096_00169_45442_0327.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_154241_000000783096_00169_45442_0326.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_154525_000001933096_00169_45442_0328.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_155114_000006223096_00169_45442_0330.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_162213_000009913096_00170_45443_0332.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_163758_000001023096_00170_45443_0394.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_164714_000001993096_00170_45443_0393.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_165136_000006283096_00170_45443_0395.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_172257_000002473096_00170_45443_0399.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_172257_000002473096_00170_45443_0401.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_172257_000002473096_00170_45443_0402.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_173241_000001143096_00170_45443_0398.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_173241_000001143096_00170_45443_0400.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_173241_000001143096_00170_45443_0403.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_173803_000002293096_00170_45443_0396.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_180411_000007553096_00171_45444_0406.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_181532_000008103096_00171_45444_0437.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_183146_000002773096_00171_45444_0438.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_190310_000002293096_00171_45444_0439.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_191141_000001873096_00171_45444_0440.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_191948_000001323096_00171_45444_0443.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_193013_000001633096_00171_45444_0442.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_193558_000005313096_00171_45444_0445.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20101108_195028_000001203096_00172_45445_0446.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_IMM_1PNPDE20101108_015432_000000993096_00161_45434_4365.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20101108_025246_000000383096_00161_45434_4367.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20101108_033239_000002853096_00162_45435_4352.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20101108_051400_000001553096_00163_45436_4387.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20101108_101719_000002003096_00166_45439_4442.N1	OK	OK	OK	OK
ASA_IMM_1PNPDK20101108_130452_000000823096_00168_45441_0237.N1	OK	OK	OK	OK
ASA_IMM_1PNPDK20101108_213205_000000373096_00173_45446_0515.N1	OK	OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WSM_1PNPDE20101108_005150_000003923096_00160_45433_4348.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_010731_000001843096_00160_45433_4350.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_013050_000003303096_00161_45434_4356.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_040950_000005143096_00162_45435_4391.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_045250_000001283096_00163_45436_4396.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_050537_000001353096_00163_45436_4386.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_054850_000005143096_00163_45436_4428.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_065249_000000923096_00164_45437_4409.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_072643_000001103096_00164_45437_4429.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_082450_000001533096_00165_45438_4434.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_100458_000003553096_00166_45439_4441.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_104459_000003923096_00166_45439_4448.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_115149_000002143096_00167_45440_4457.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_120730_000001043096_00167_45440_4458.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_121124_000002143096_00167_45440_4459.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_122339_000002143096_00167_45440_4460.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_140738_000003303096_00168_45441_4485.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_154839_000001473096_00169_45442_4486.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_164439_000001533096_00170_45443_4489.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_172707_000003123096_00170_45443_4492.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_173441_000001903096_00170_45443_4490.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_180122_000000923096_00171_45444_4493.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_190705_000002693096_00171_45444_4496.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_191449_000003003096_00171_45444_4494.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_204743_000002143096_00172_45445_4523.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_205350_000003123096_00172_45445_4524.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_213949_000004343096_00173_45446_4539.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_230447_000002753096_00174_45447_4544.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20101108_230926_000002083096_00174_45447_4545.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_064411_000002083096_00164_45437_9900.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_072843_000002083096_00164_45437_9893.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_072843_000002083096_00164_45437_9894.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_082750_000000923096_00165_45438_0004.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_082939_000002143096_00165_45438_0005.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_090213_000003923096_00165_45438_0105.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_090950_000002083096_00165_45438_0104.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_114318_000000923096_00167_45440_0134.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_122739_000002143096_00167_45440_0233.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_132459_000002083096_00168_45441_0240.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_163951_000002083096_00170_45443_0339.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_195237_000000923096_00172_45445_0448.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_195237_000000923096_00172_45445_0449.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_195606_000002753096_00172_45445_0456.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_213307_000001533096_00173_45446_0516.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_231451_000000923096_00174_45447_0544.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20101108_231831_000001533096_00174_45447_0545.N1					OK	OK	OK	OK





Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20101108_001010_000008993096_00160_45433_4337.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_003418_000003303096_00160_45433_4340.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_005924_000002543096_00160_45433_4341.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_010239_000002553096_00160_45433_4353.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_011451_000008243096_00160_45433_4360.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_020754_000007343096_00161_45434_4362.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_023947_000002253096_00161_45434_4379.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_034111_000007793096_00162_45435_4378.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_035356_000002403096_00162_45435_4397.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_042020_000011093096_00162_45435_4399.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_052011_000010193096_00163_45436_4400.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_053656_000002103096_00163_45436_4412.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_060015_000017843096_00163_45436_4418.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_071503_000001953096_00164_45437_4421.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_201106_000018893096_00172_45445_4516.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_210222_000003003096_00172_45445_4534.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_215057_000019193096_00173_45446_4536.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_224236_000003303096_00173_45446_4537.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_224706_000007043096_00173_45446_4550.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_231256_000000753096_00174_45447_4548.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_233336_000008843096_00174_45447_4554.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20101108_235908_000002403096_00174_45447_4557.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_071803_000001653096_00164_45437_9898.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_074029_000018593096_00164_45437_9895.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_085116_000005853096_00165_45438_0095.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_092043_000019193096_00165_45438_0098.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_102519_000009593096_00166_45439_0129.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_110057_000018743096_00166_45439_0148.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_114843_000001503096_00167_45440_0219.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_115721_000005693096_00167_45440_0221.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_121455_000003903096_00167_45440_0224.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_124111_000002403096_00167_45440_0226.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_125610_000004873096_00167_45440_0229.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_130620_000000593096_00168_45441_0231.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_133014_000008093096_00168_45441_0280.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_142125_000003003096_00168_45441_0281.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_143116_000001193096_00168_45441_0285.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_143116_000001193096_00168_45441_0286.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_152440_000010343096_00169_45442_0329.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_160139_000011843096_00169_45442_0331.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_170209_000011993096_00170_45443_0397.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_174154_000011243096_00170_45443_0409.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_183624_000015593096_00171_45444_0441.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_192208_000004503096_00171_45444_0444.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20101108_193300_000001343096_00171_45444_0447.N1					OK	OK	OK	OK

### Calibration pulses for GM1 SS3 H/H

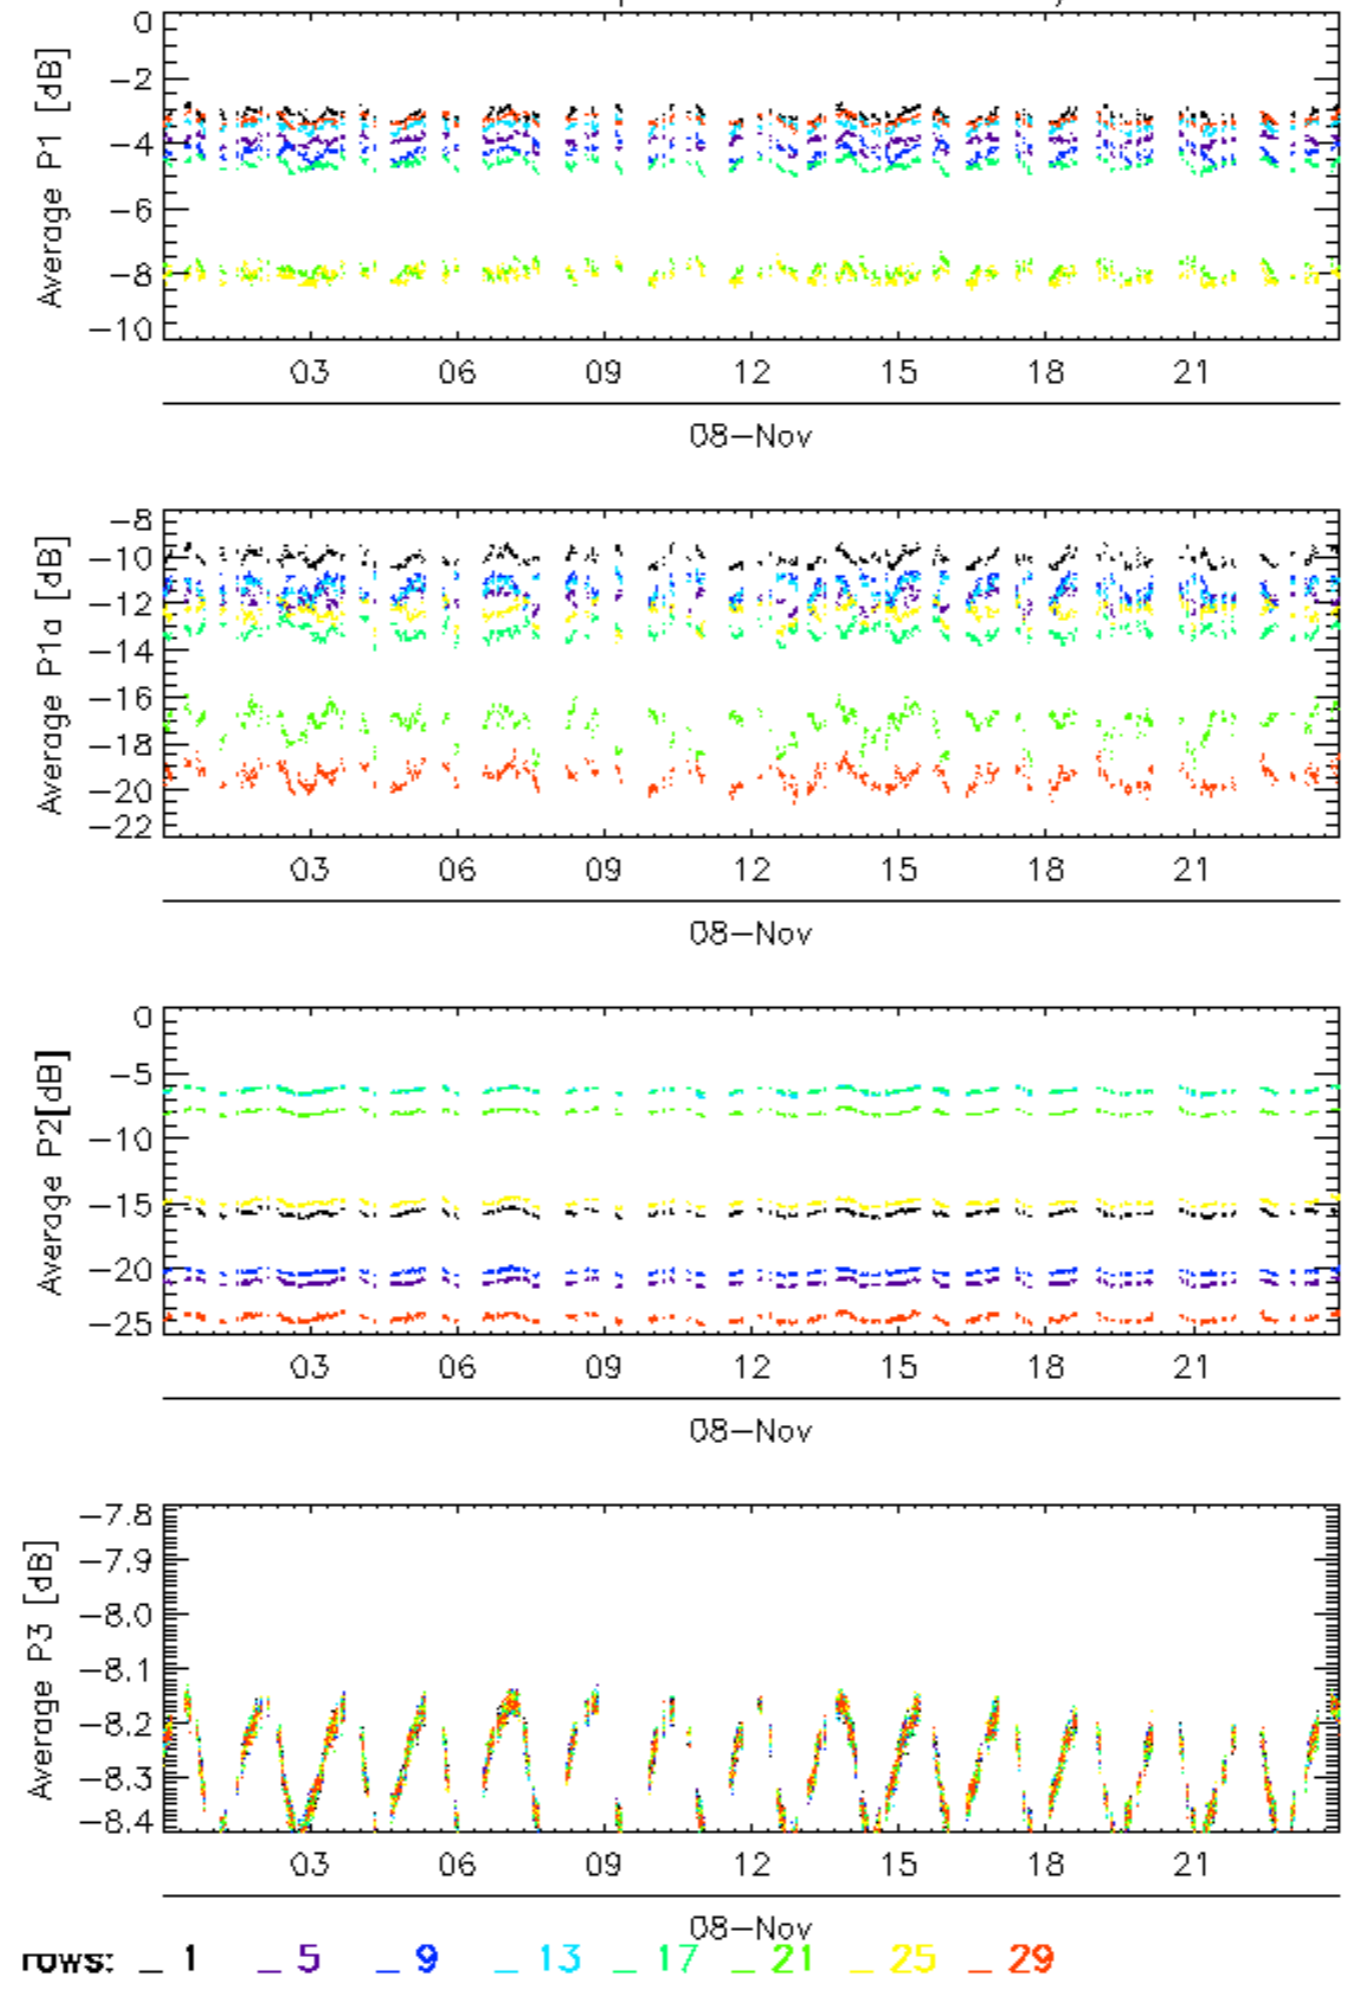


Calibration pulses for GM1 SS3 H/H

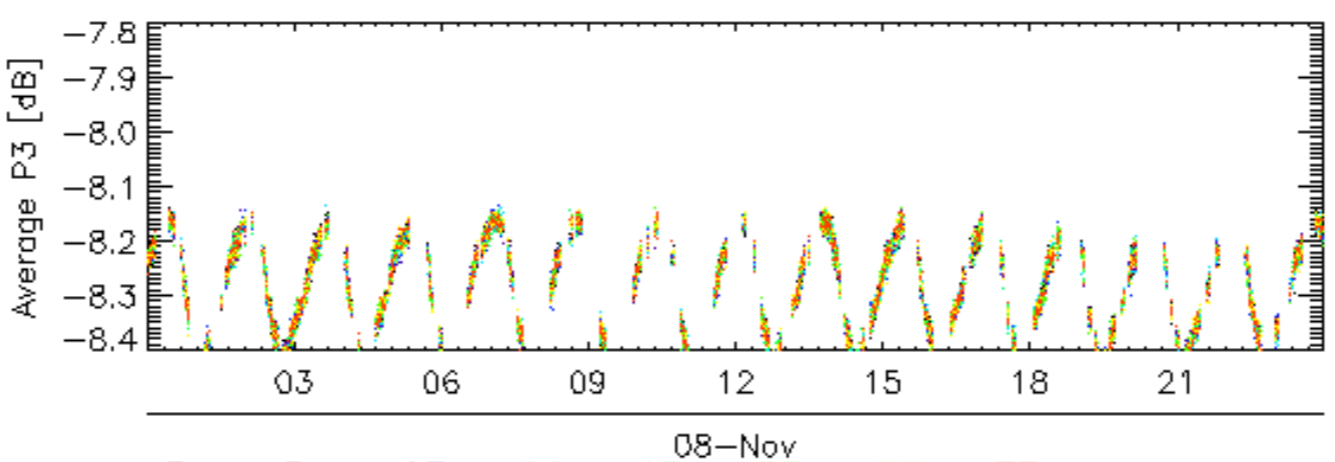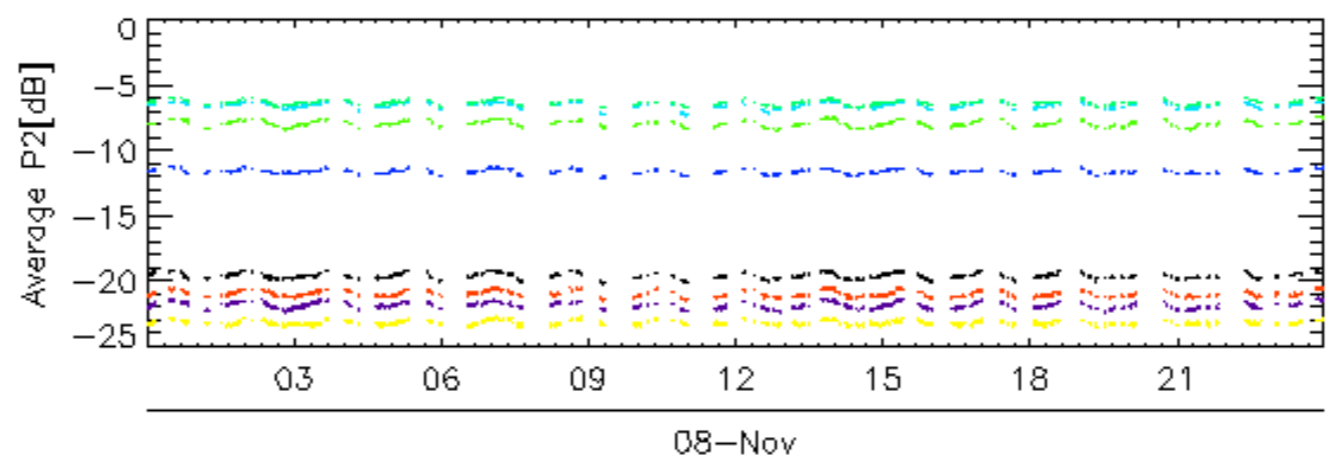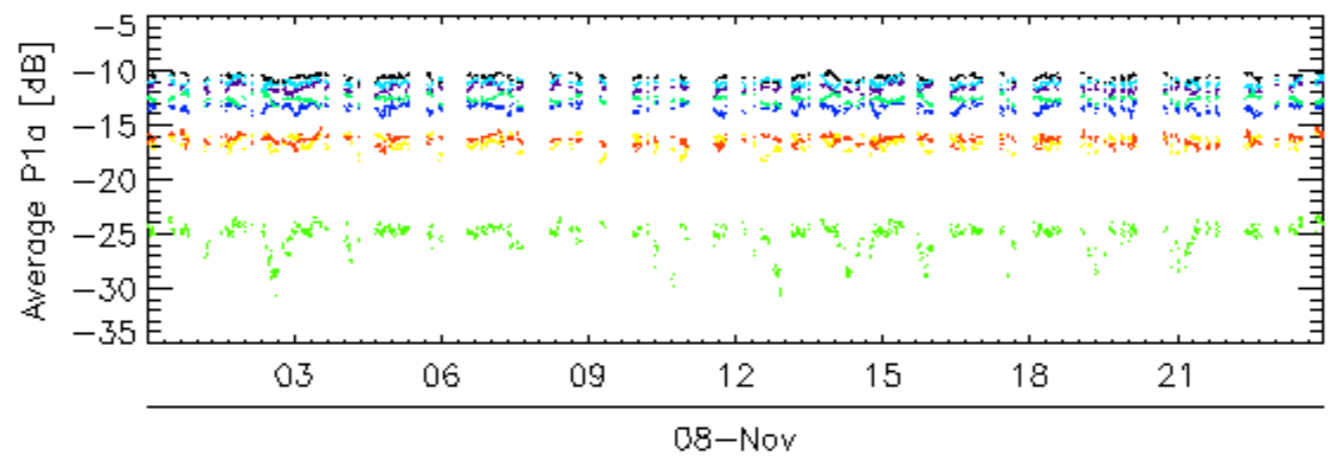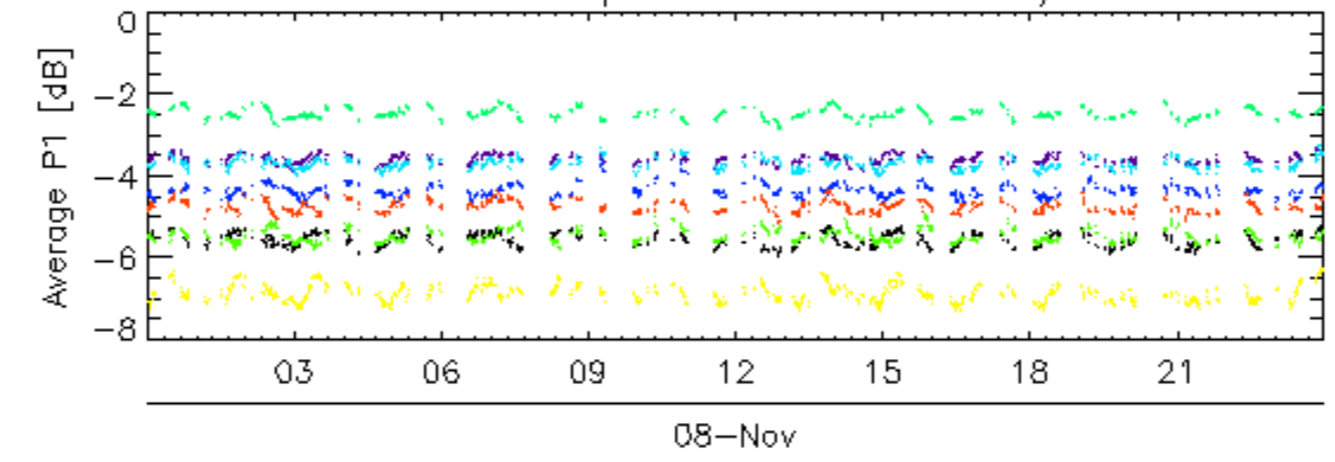





rows: 2 6 10 14 18 22 26 30

Calibration pulses for GM1 SS3 H/H

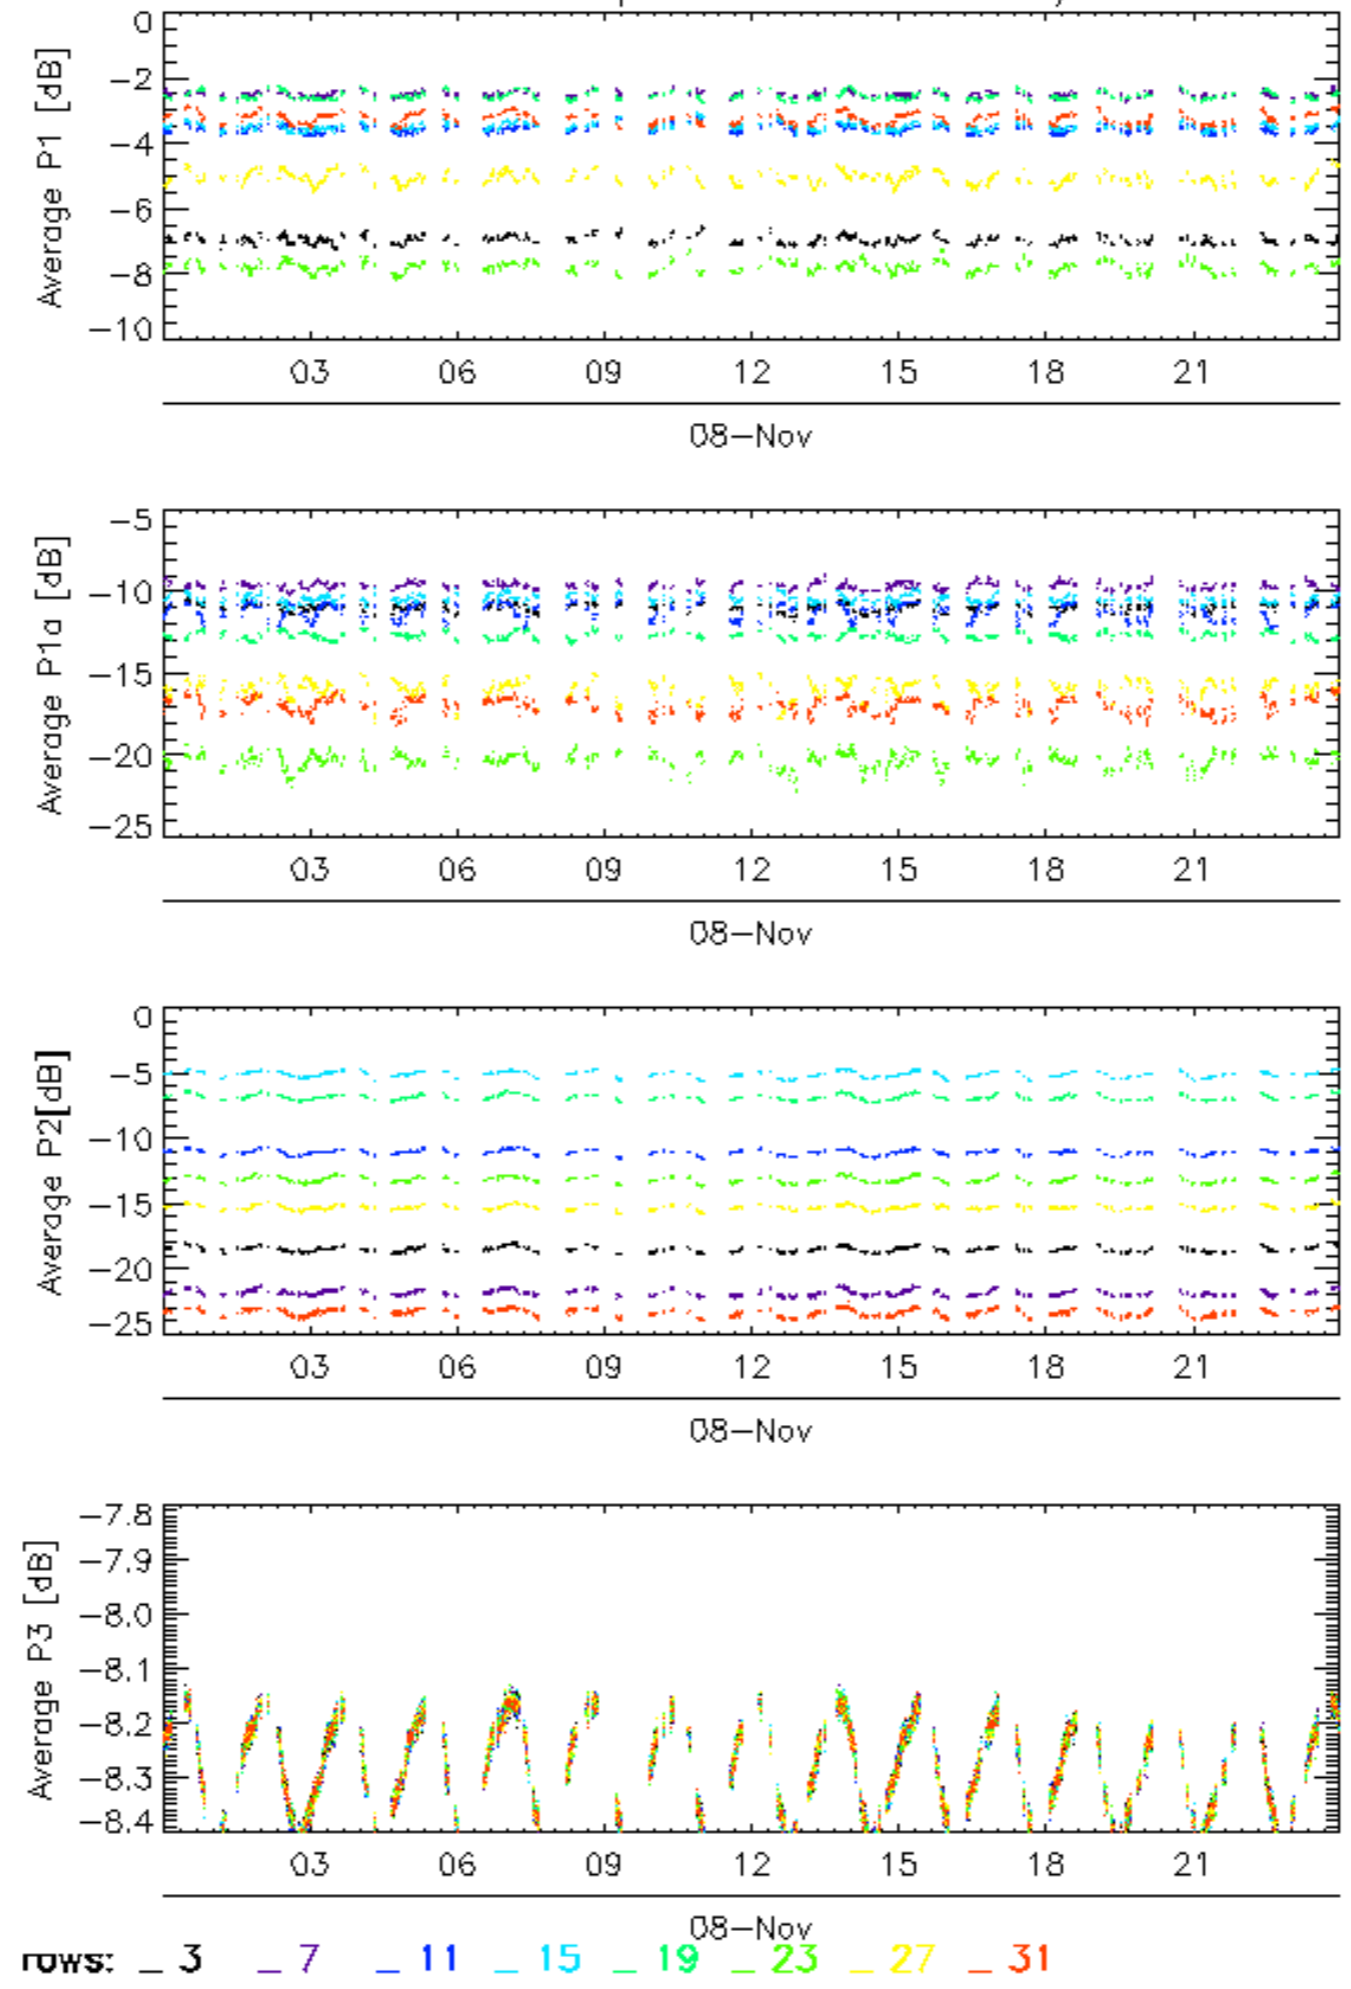





Calibration pulses for GM1 SS3 H/H

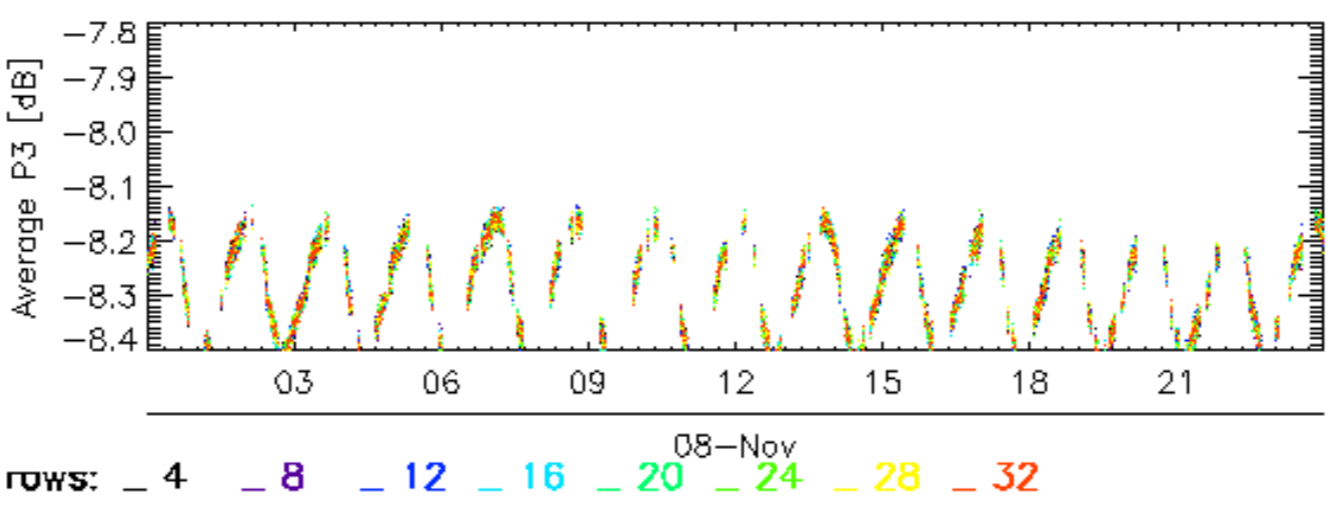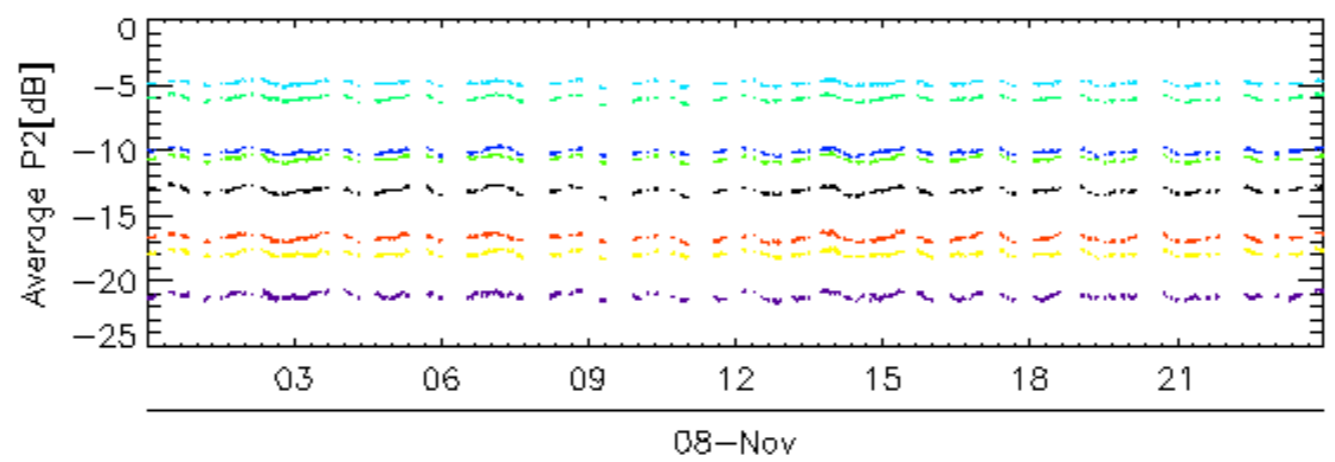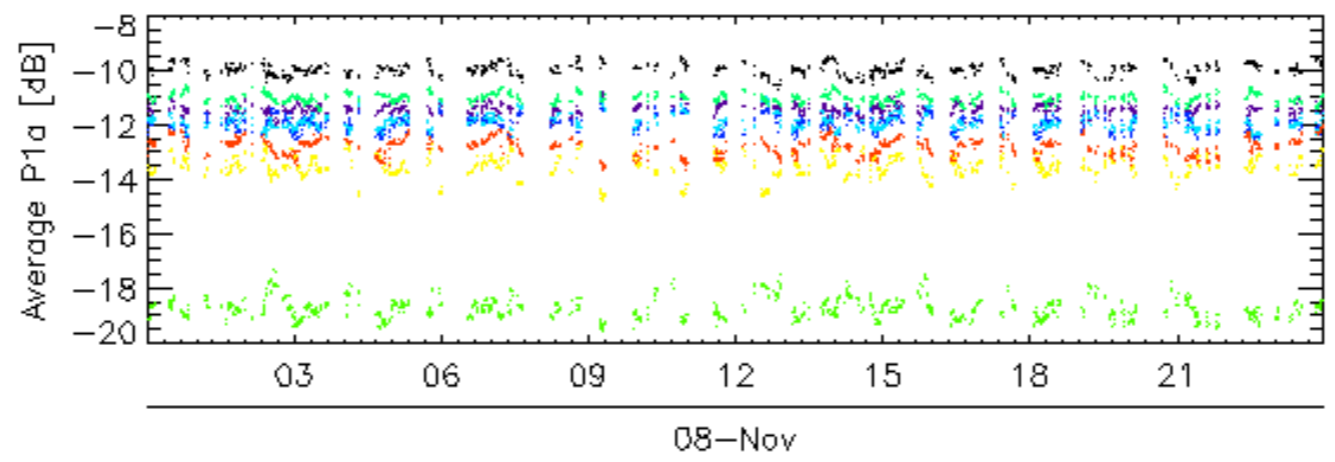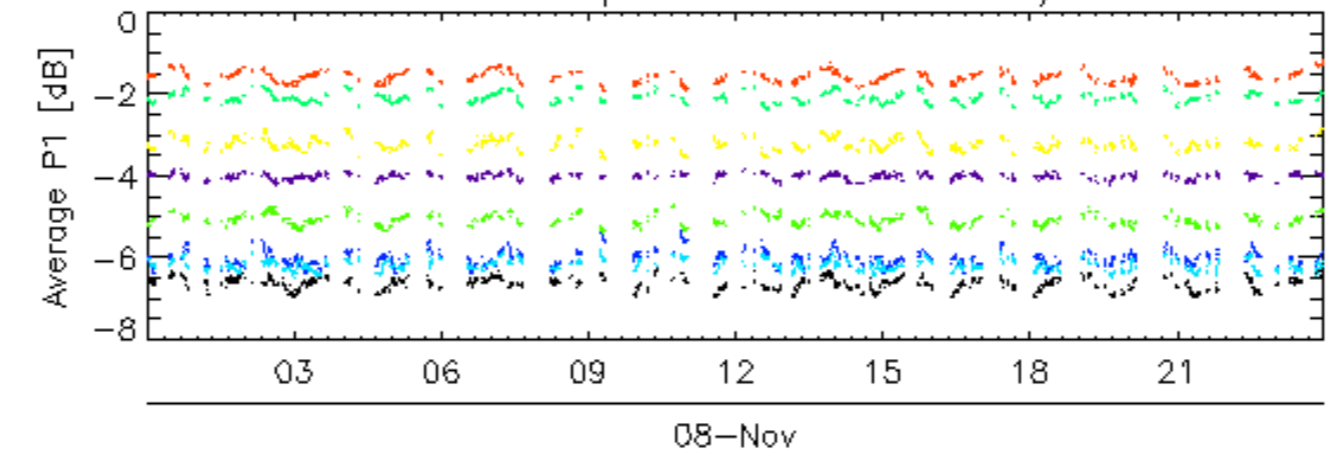


### Calibration pulses for WVS IS2 V/V

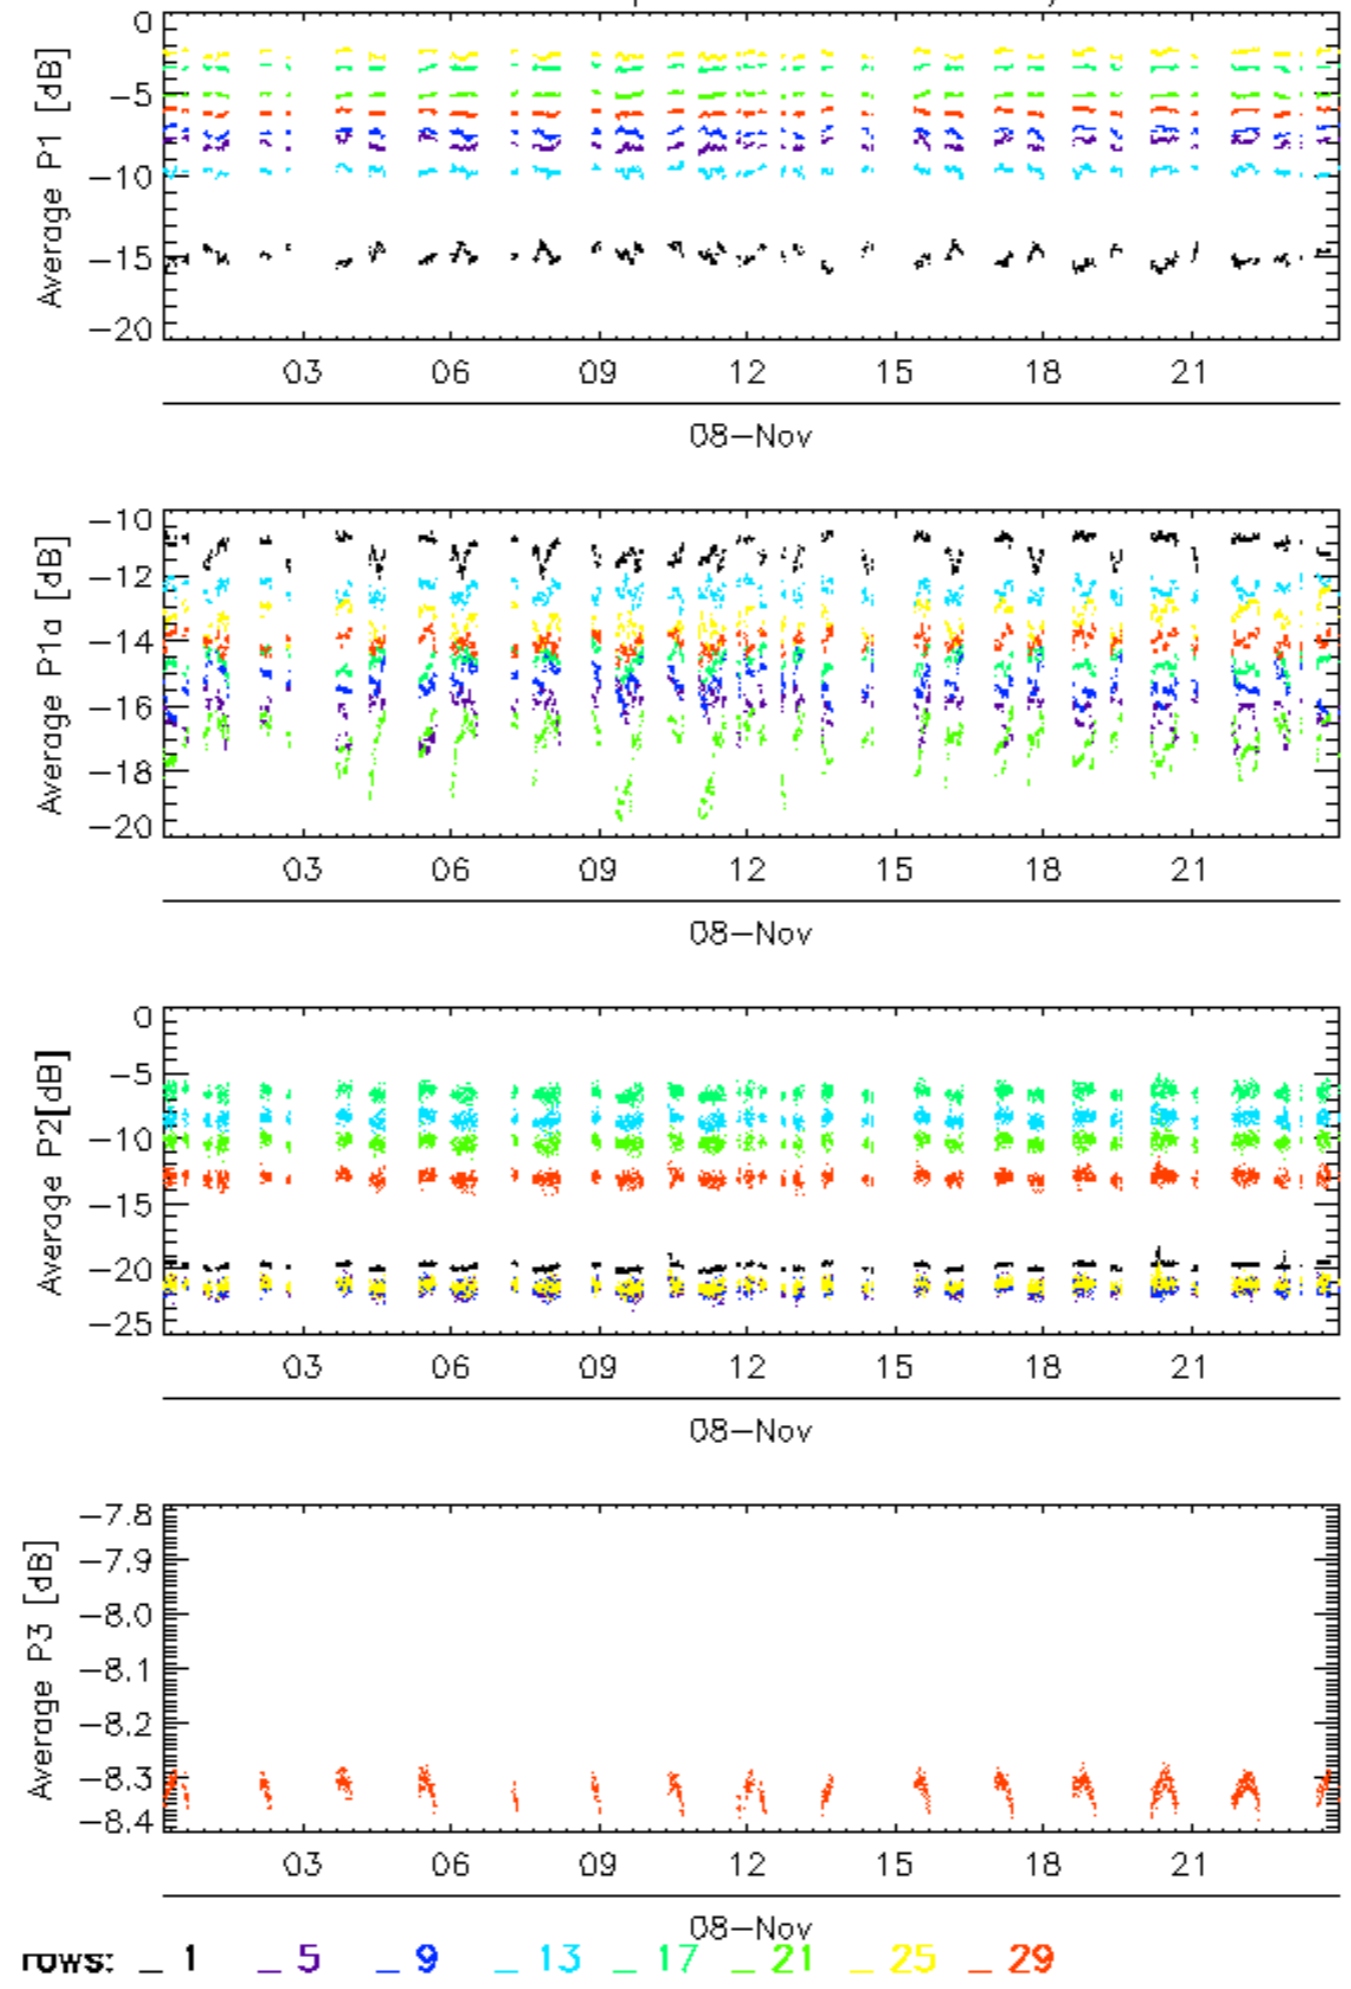


### Calibration pulses for WVS IS2 V/V

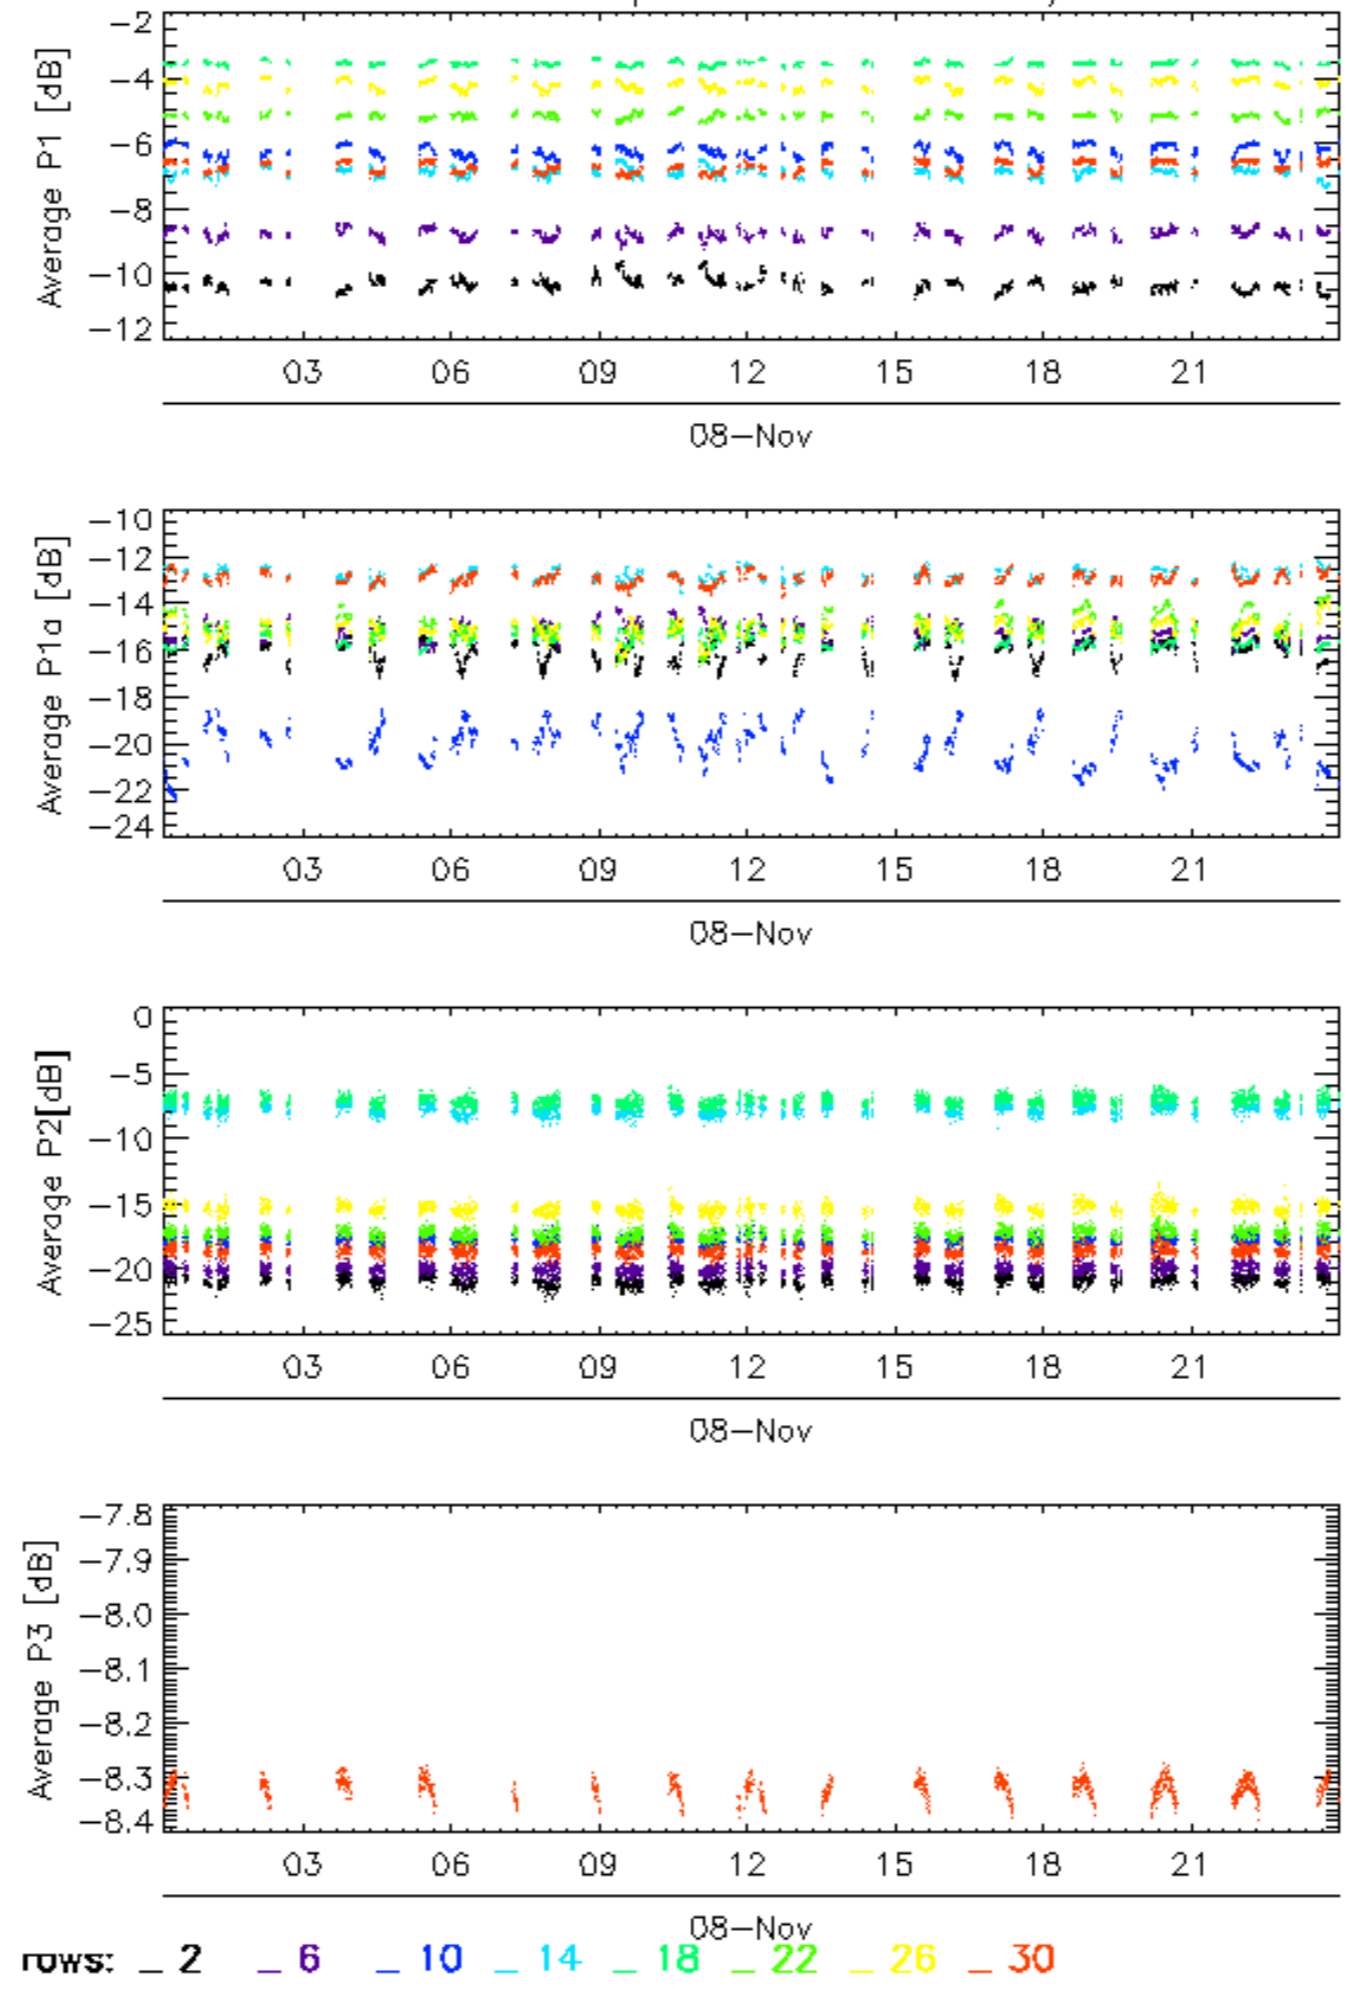



Calibration pulses for WVS IS2 V/V


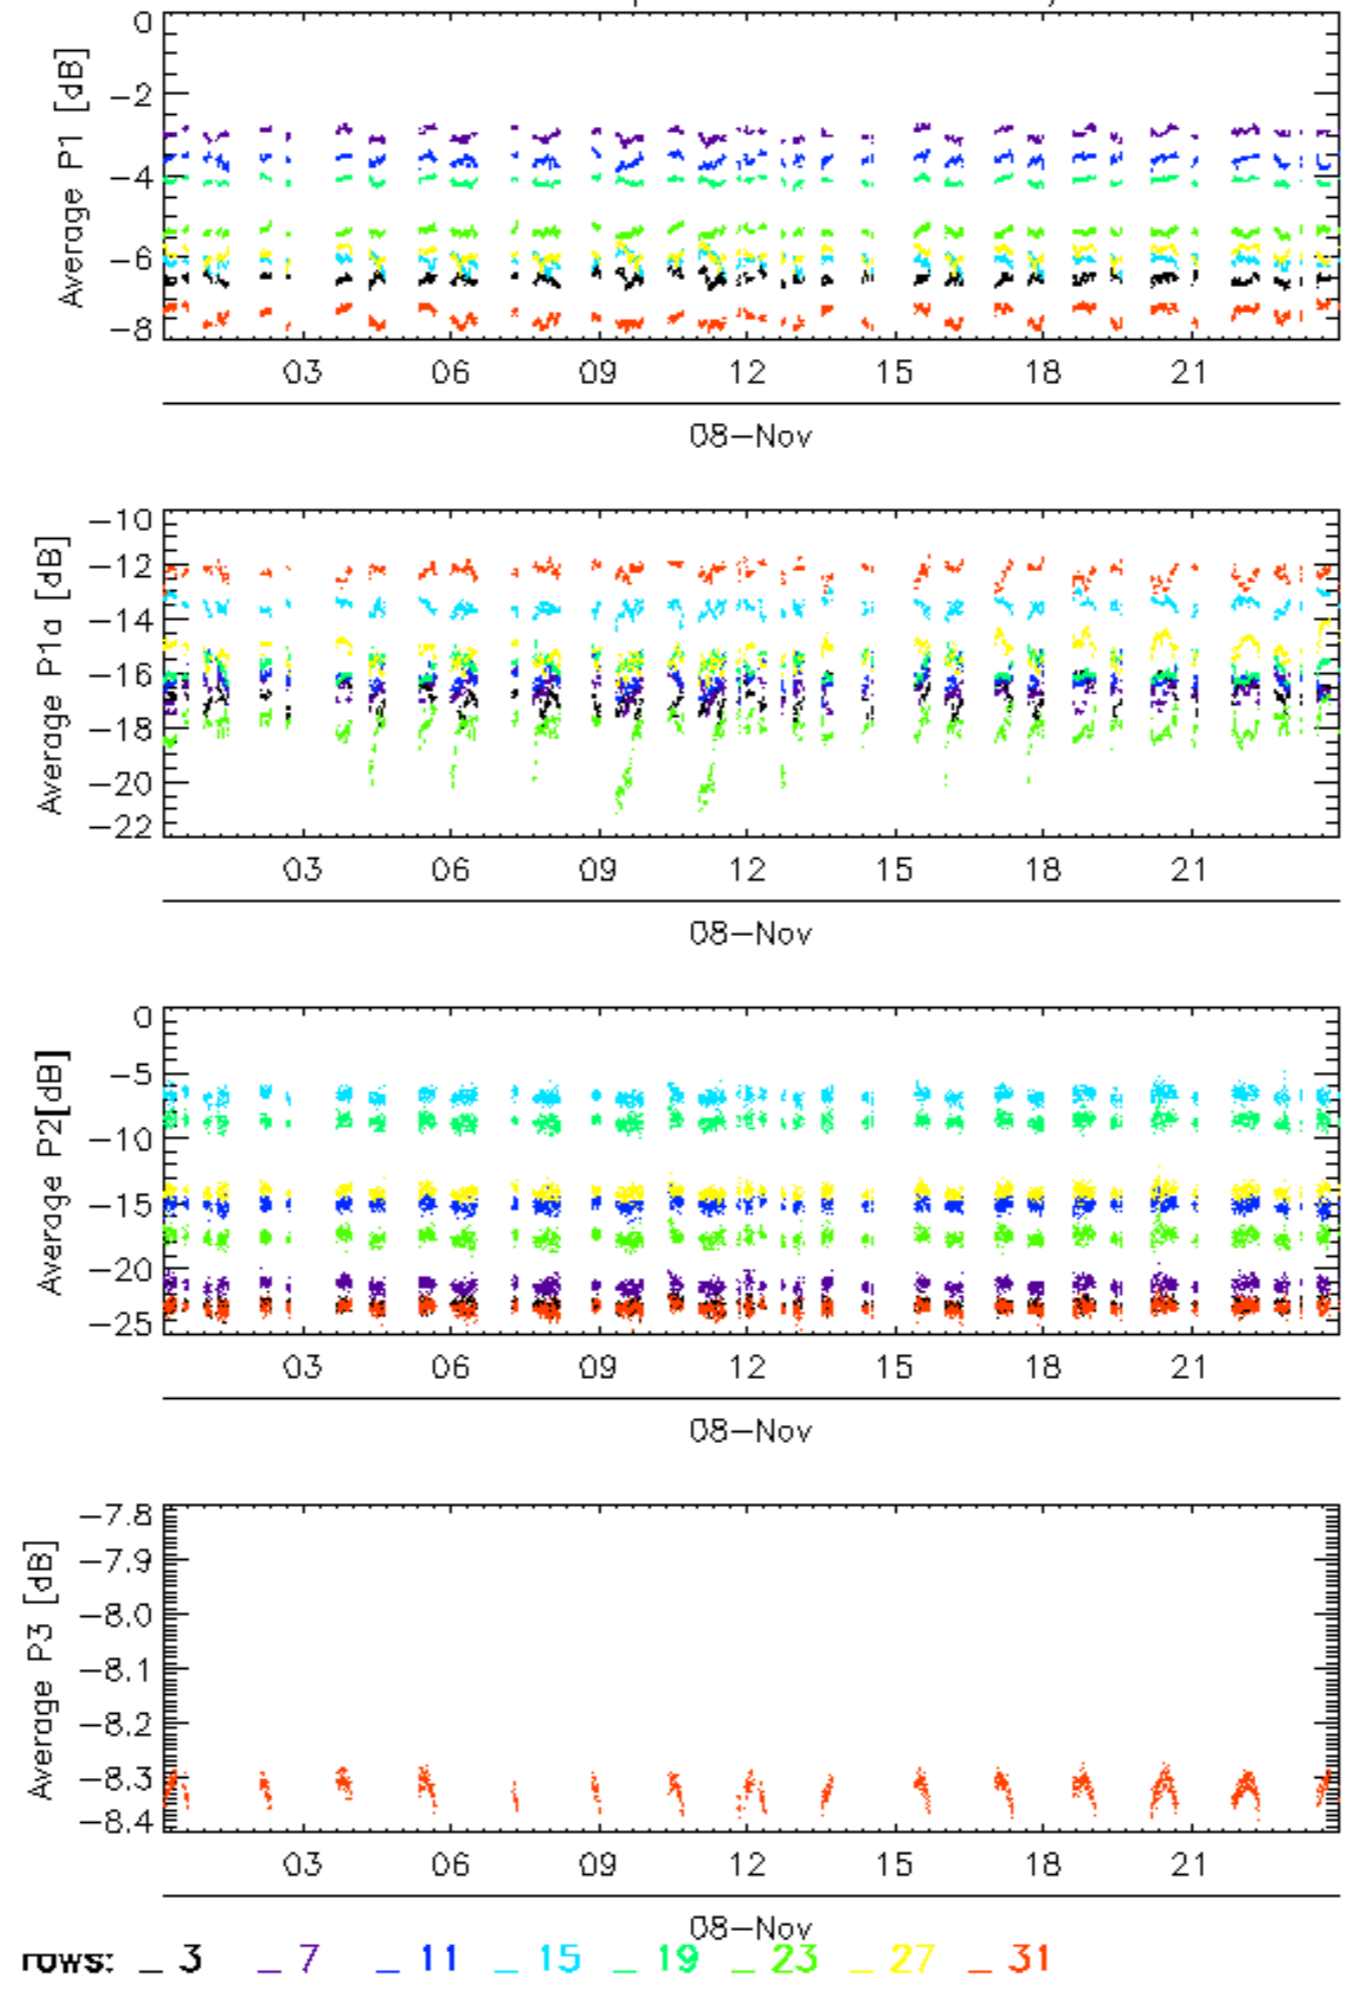


Calibration pulses for WVS IS2 V/V

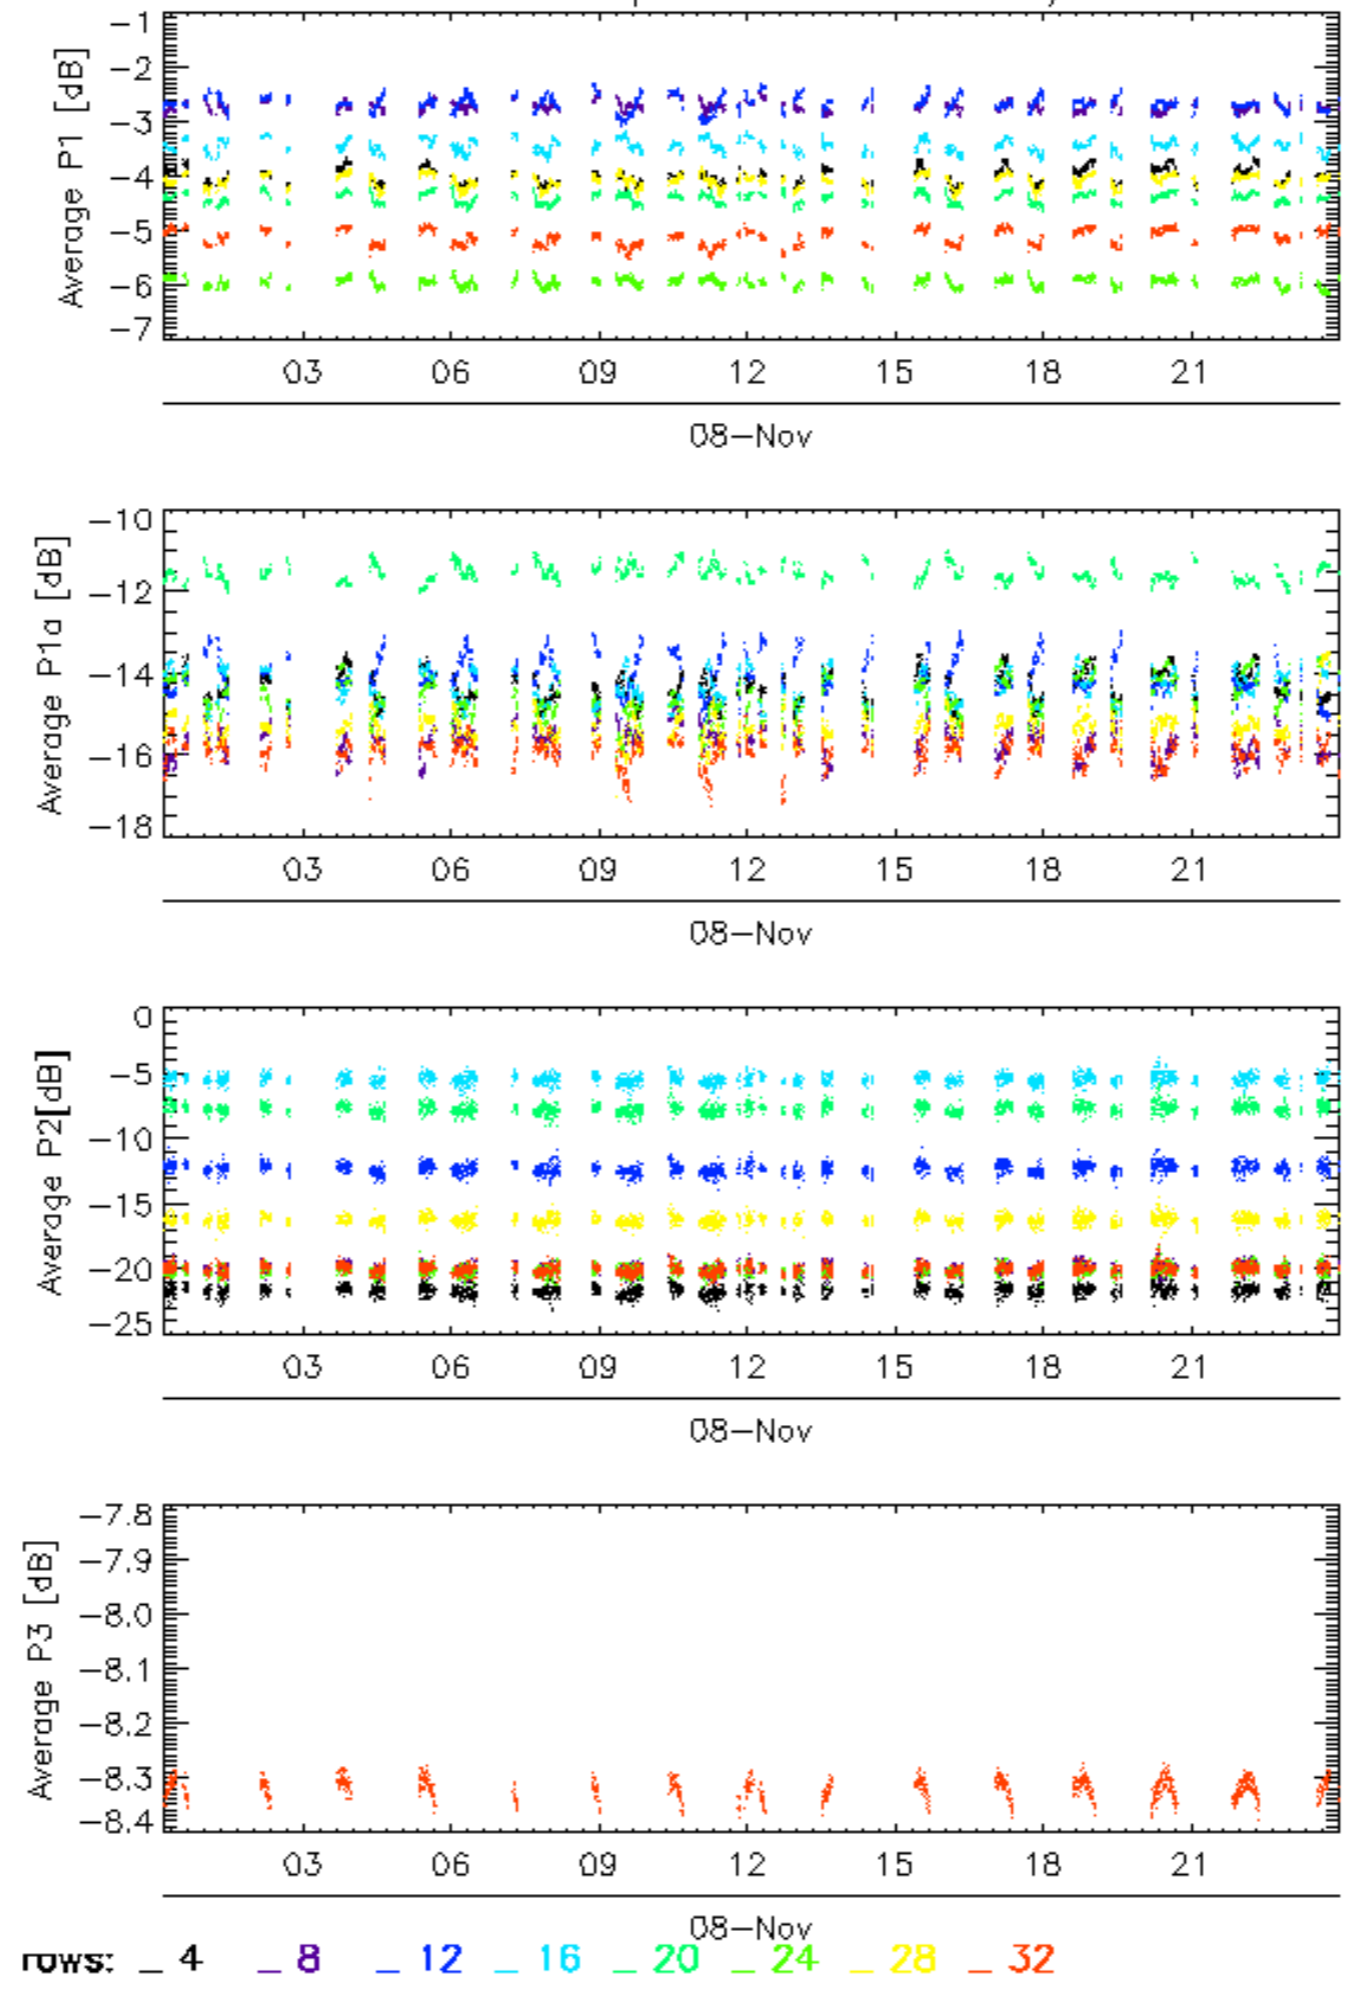


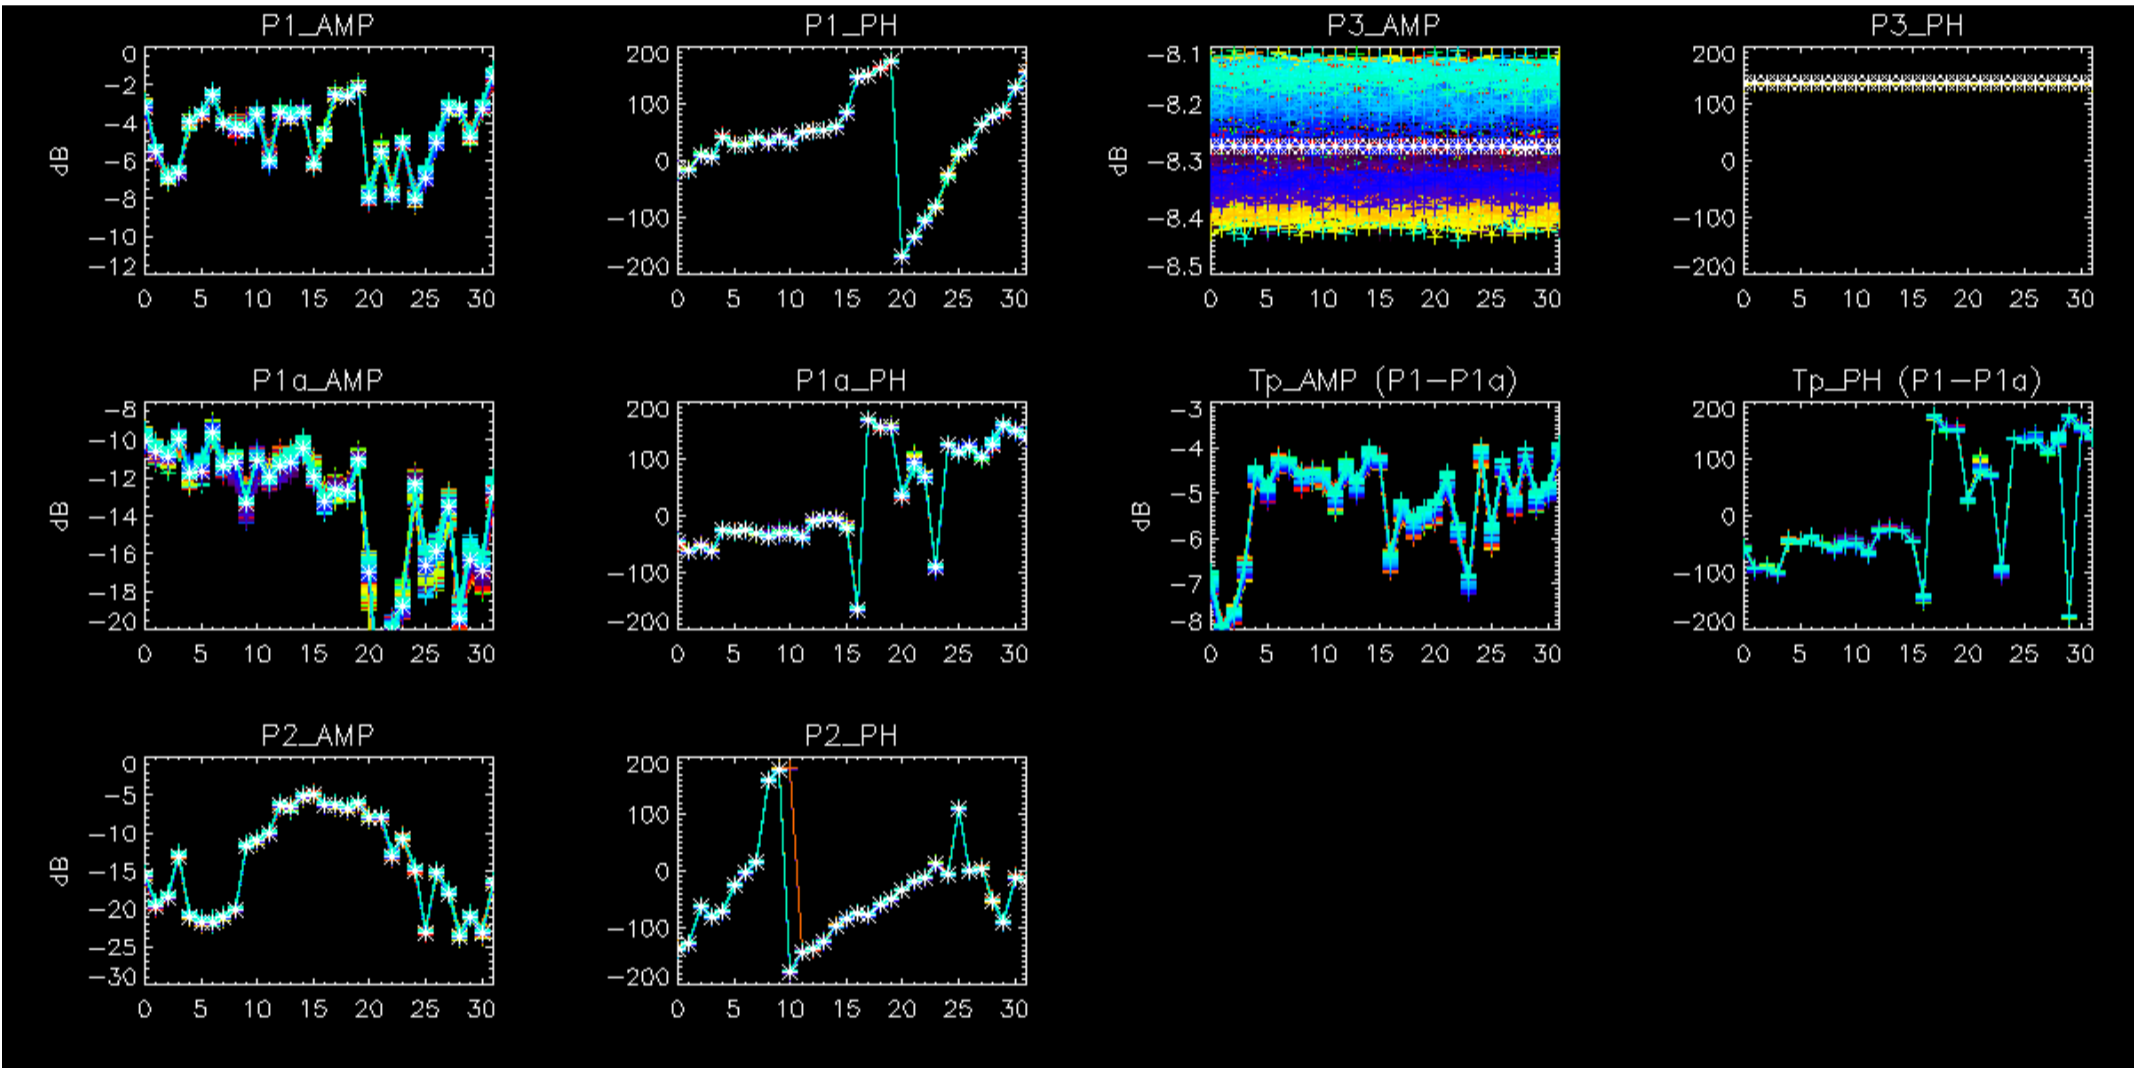



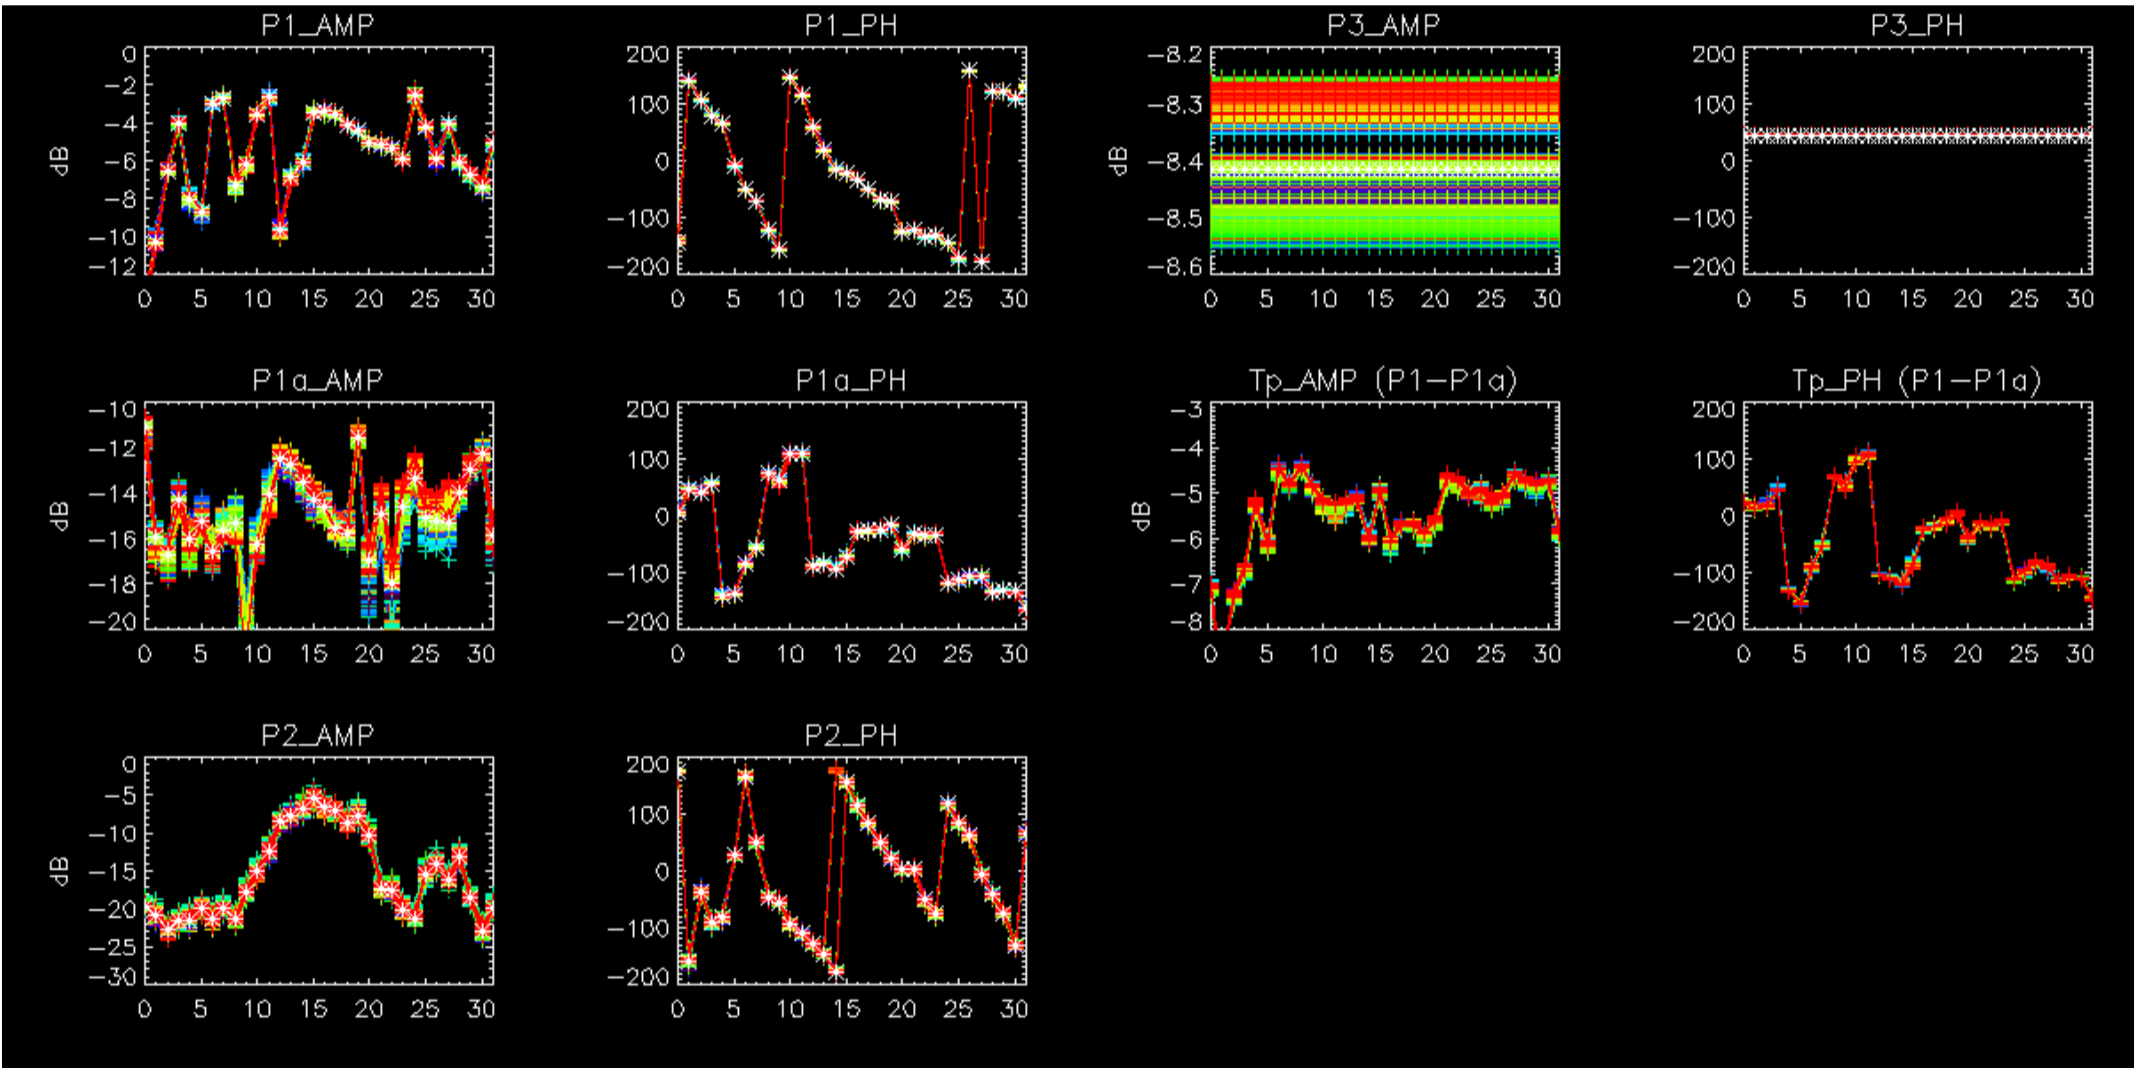


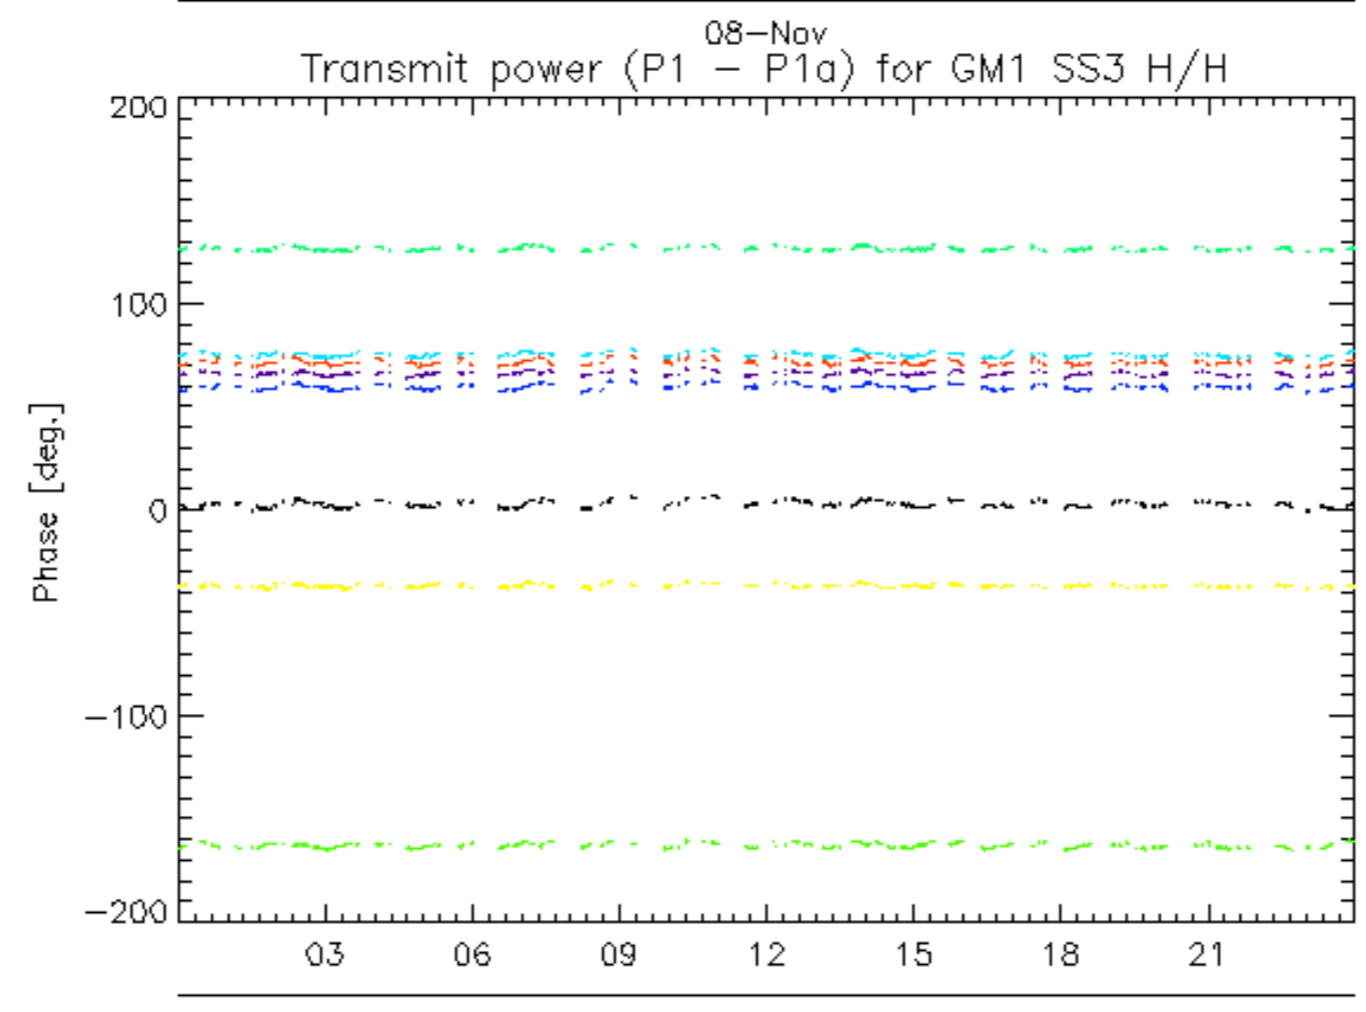
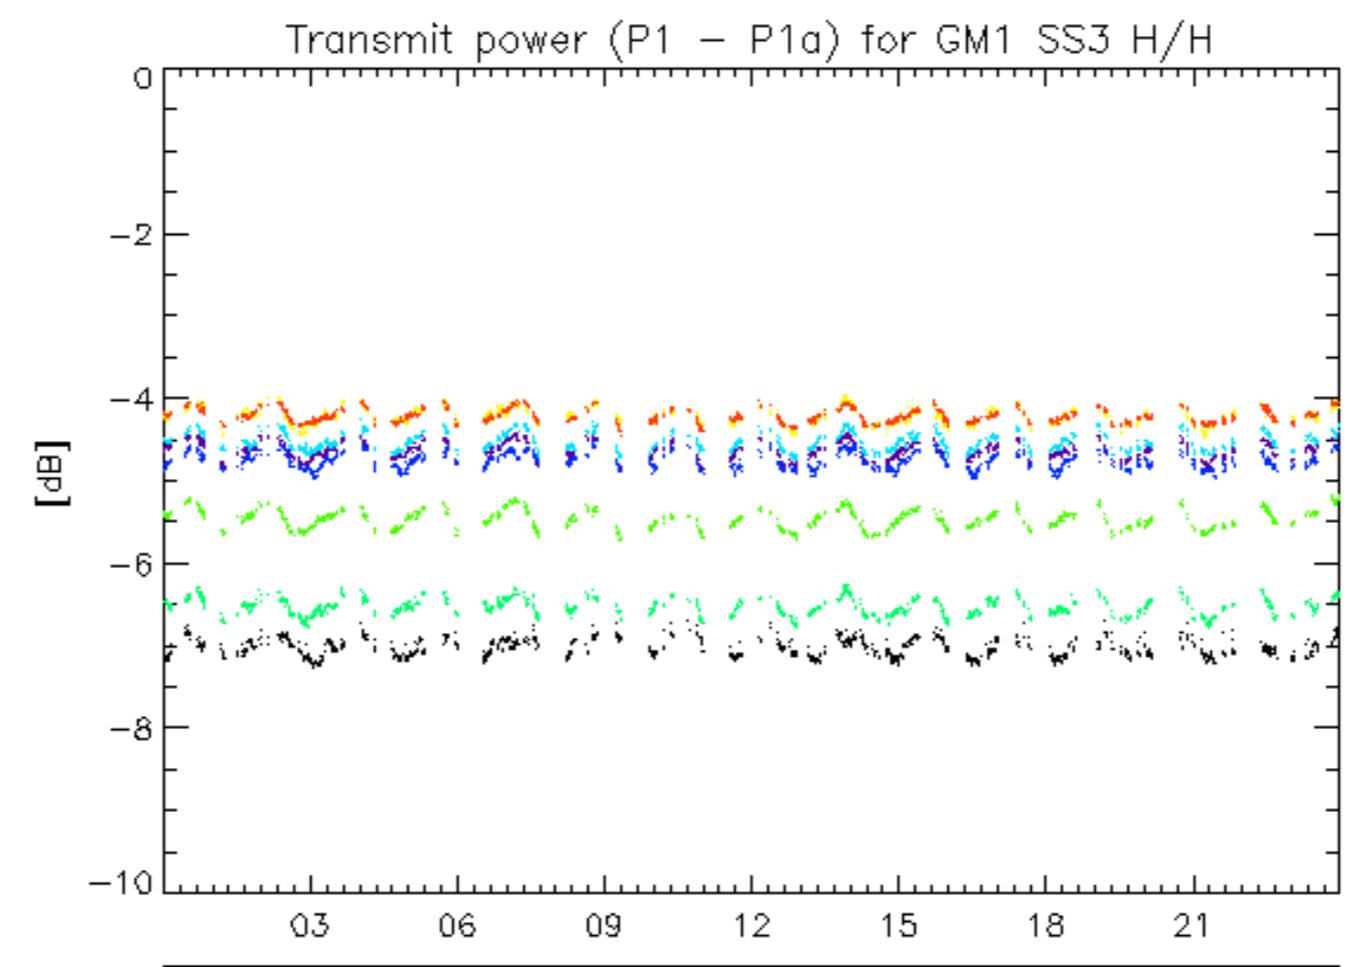




rows: \_ 1 \_ 5 \_ 9 \_ 13 \_ 17 \_ 21 \_ 25 \_ 29





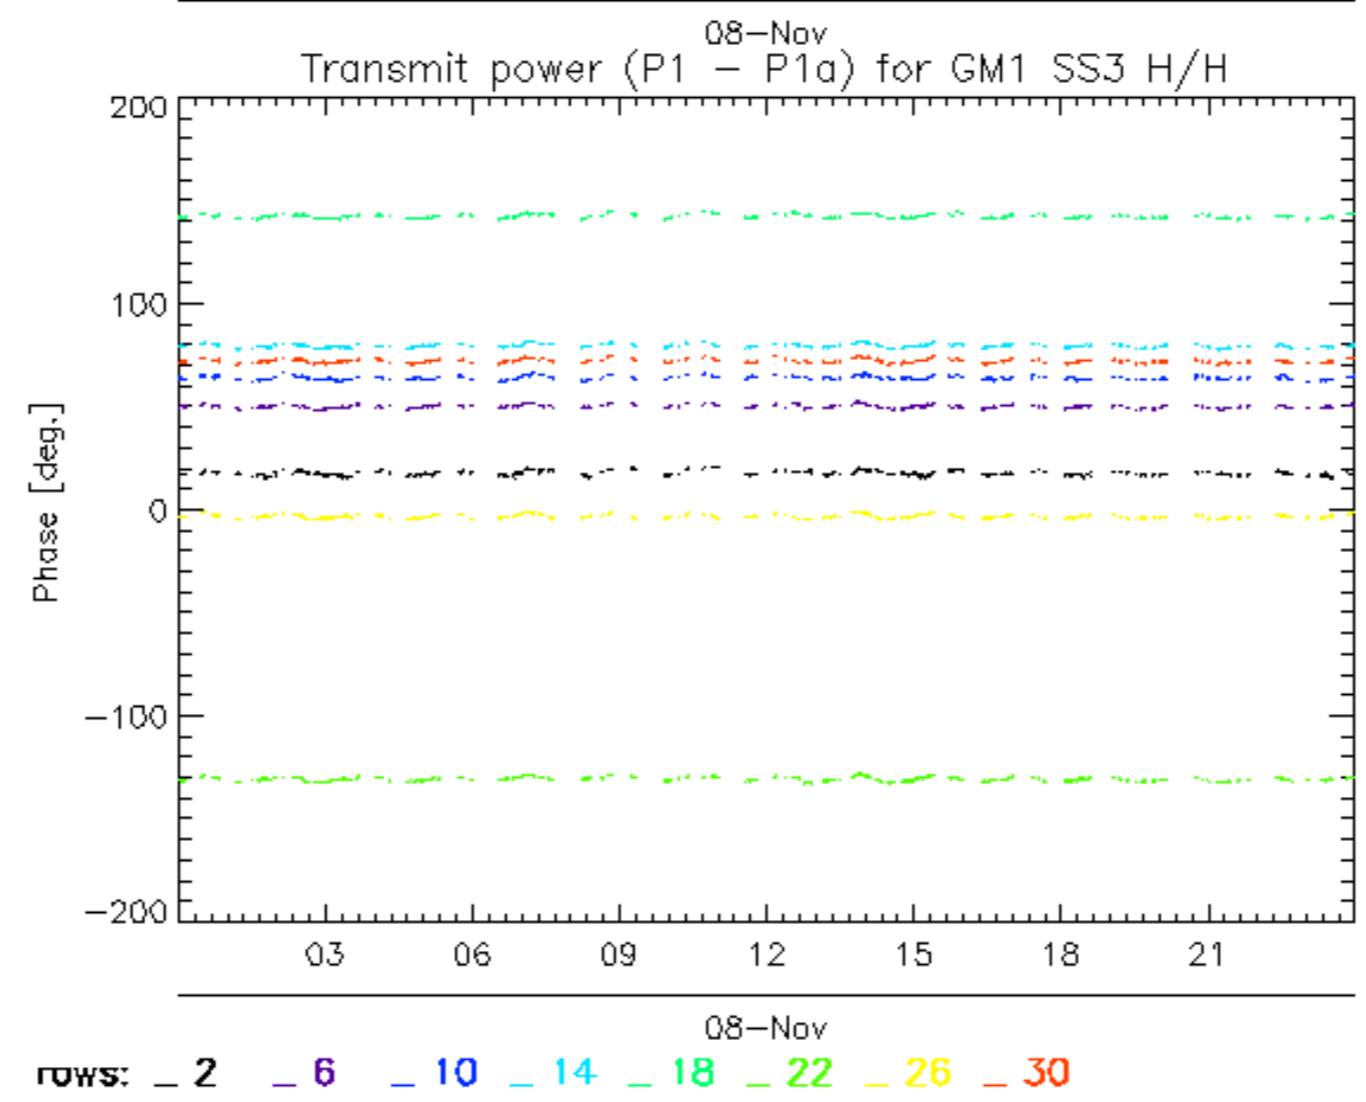
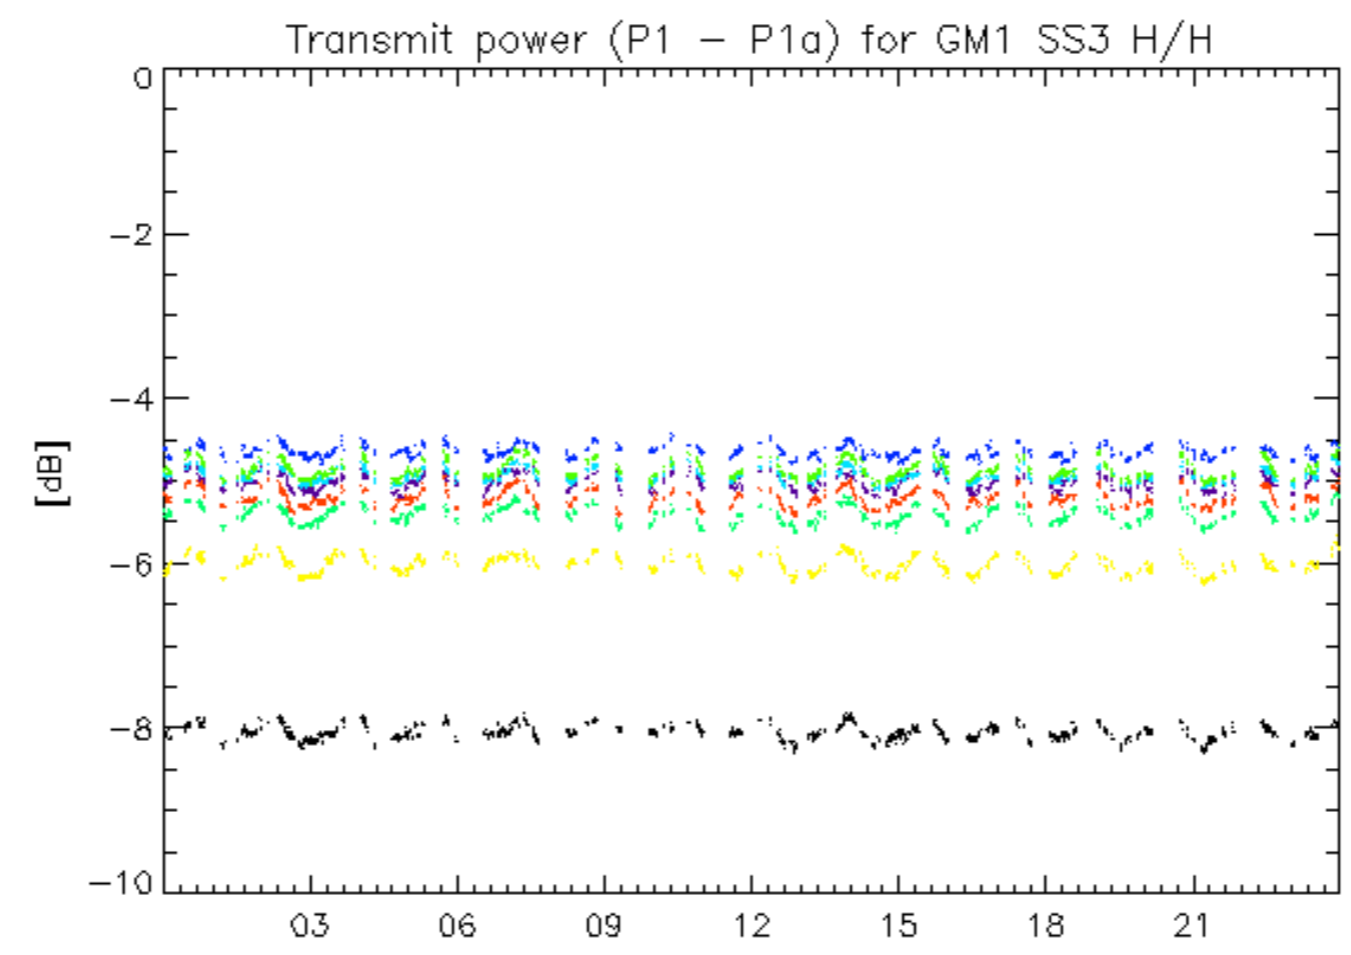


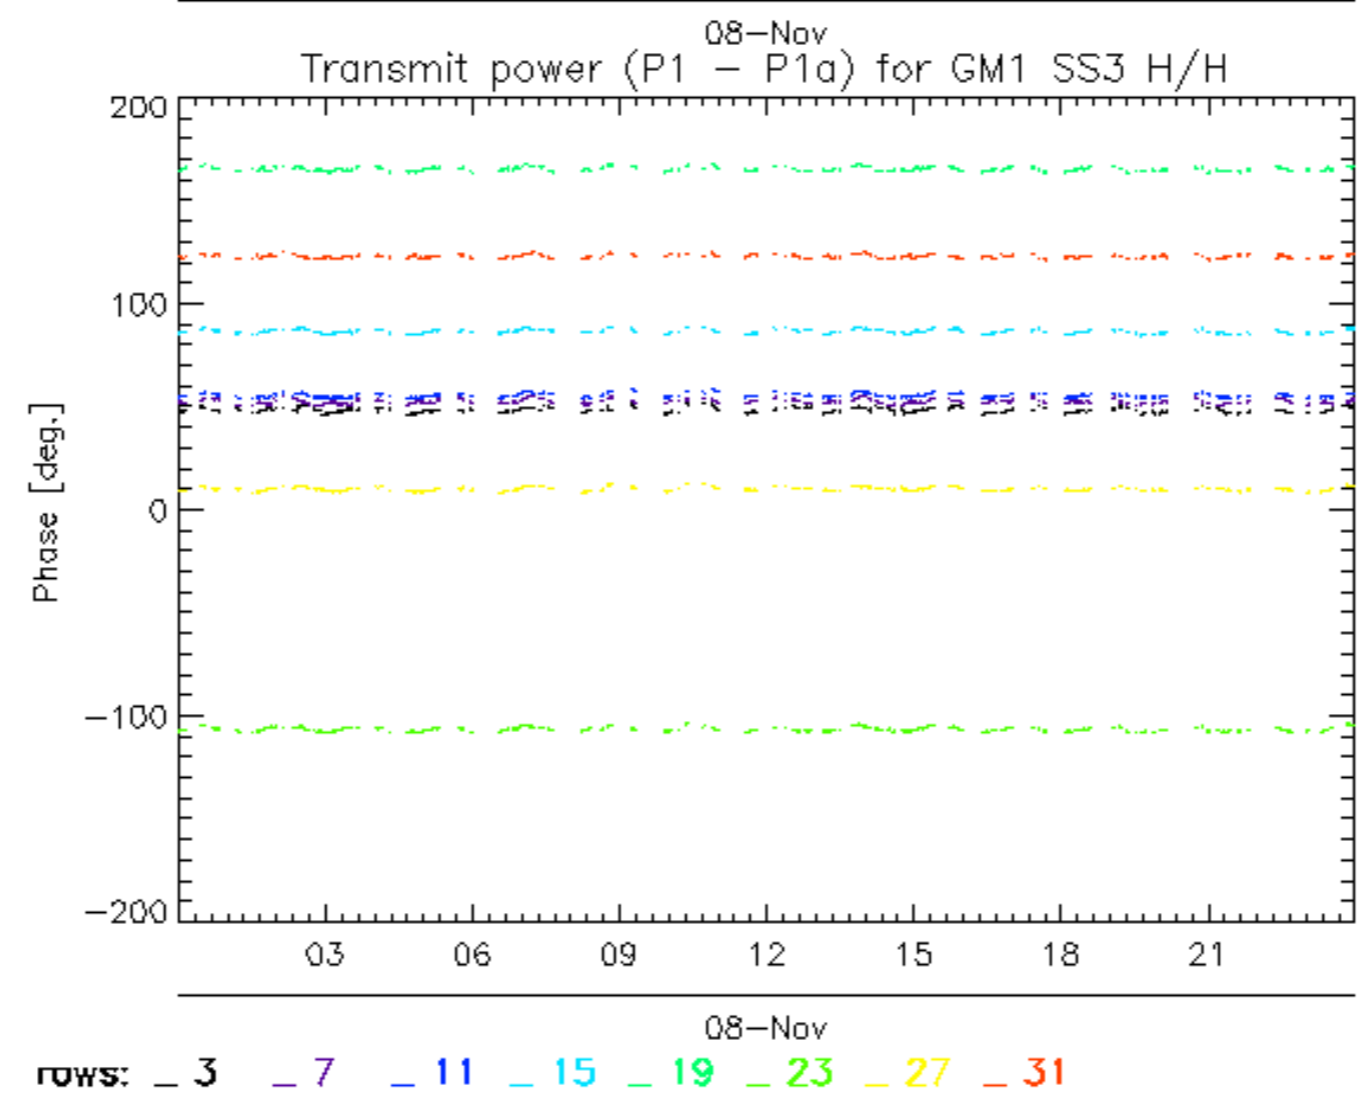
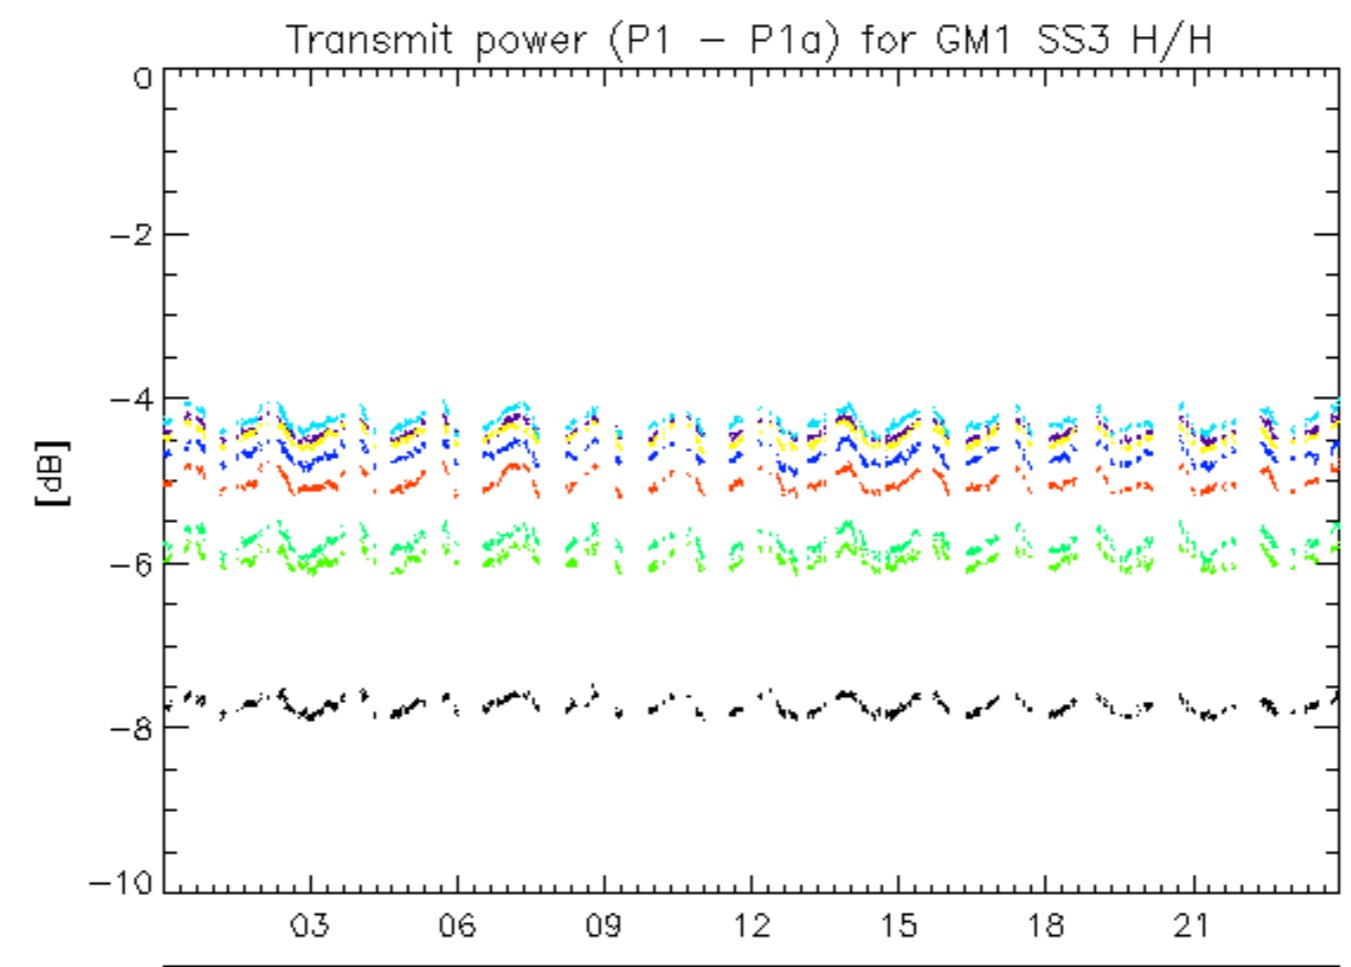


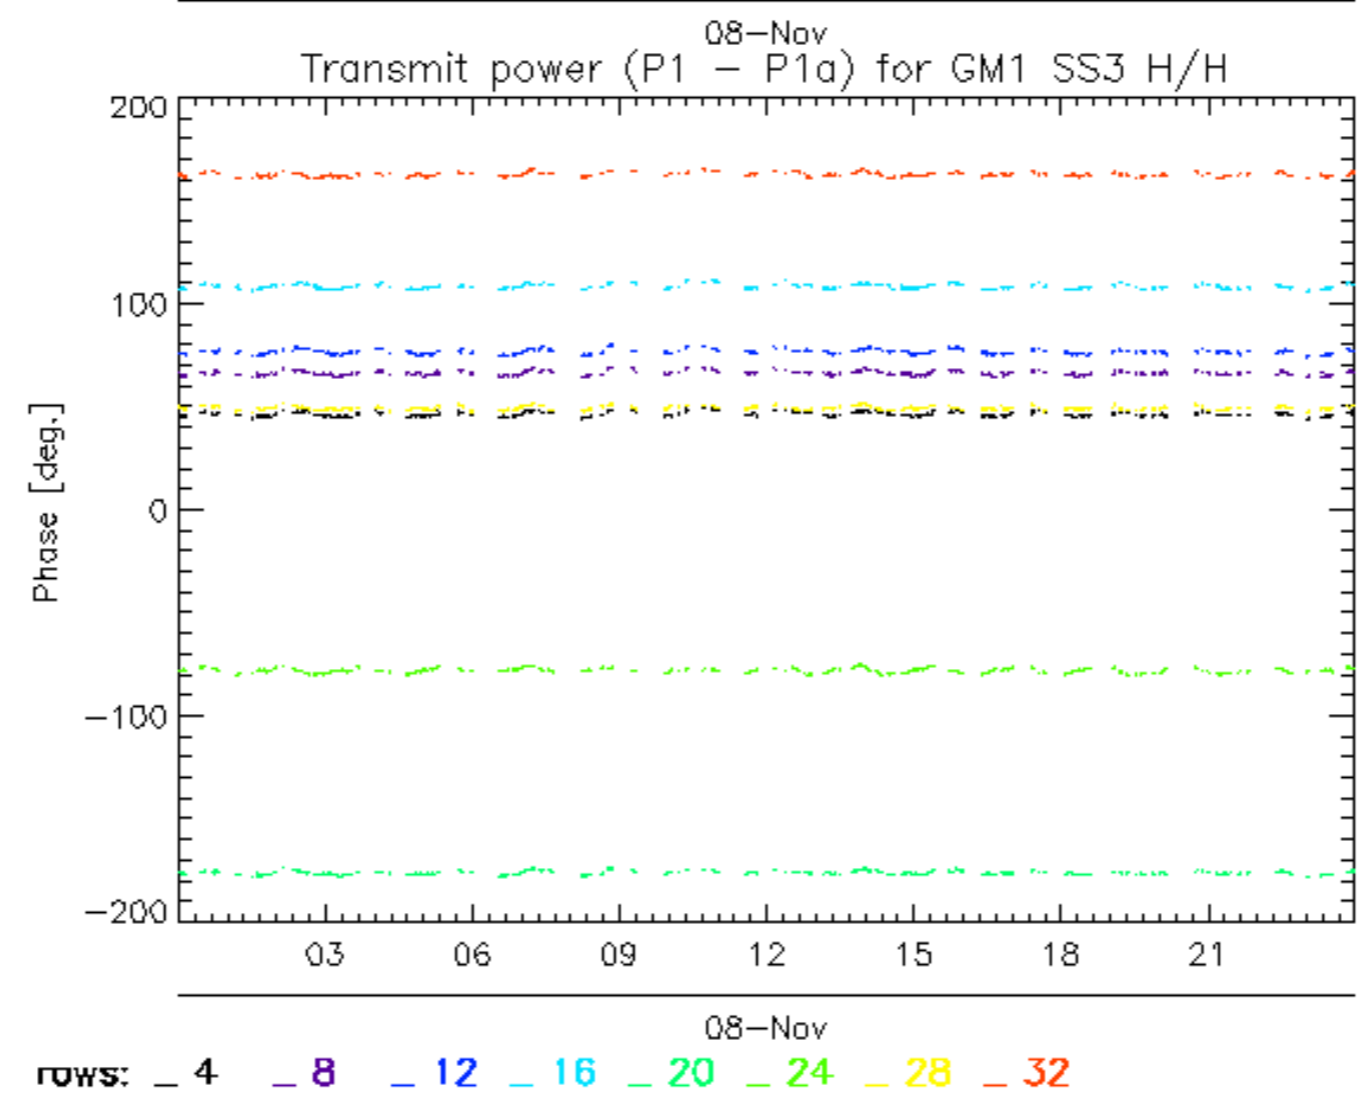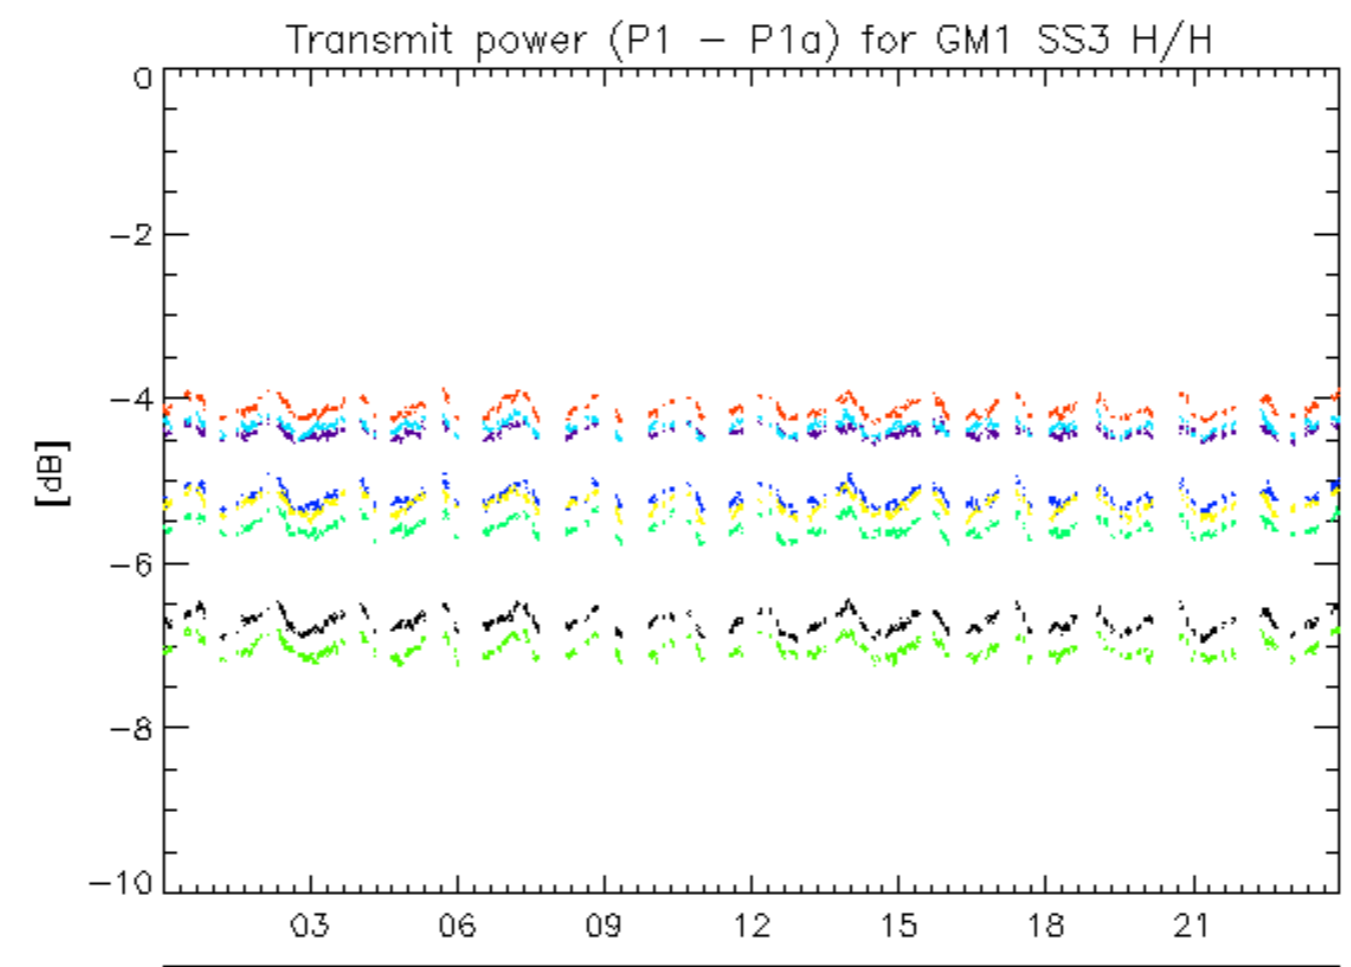


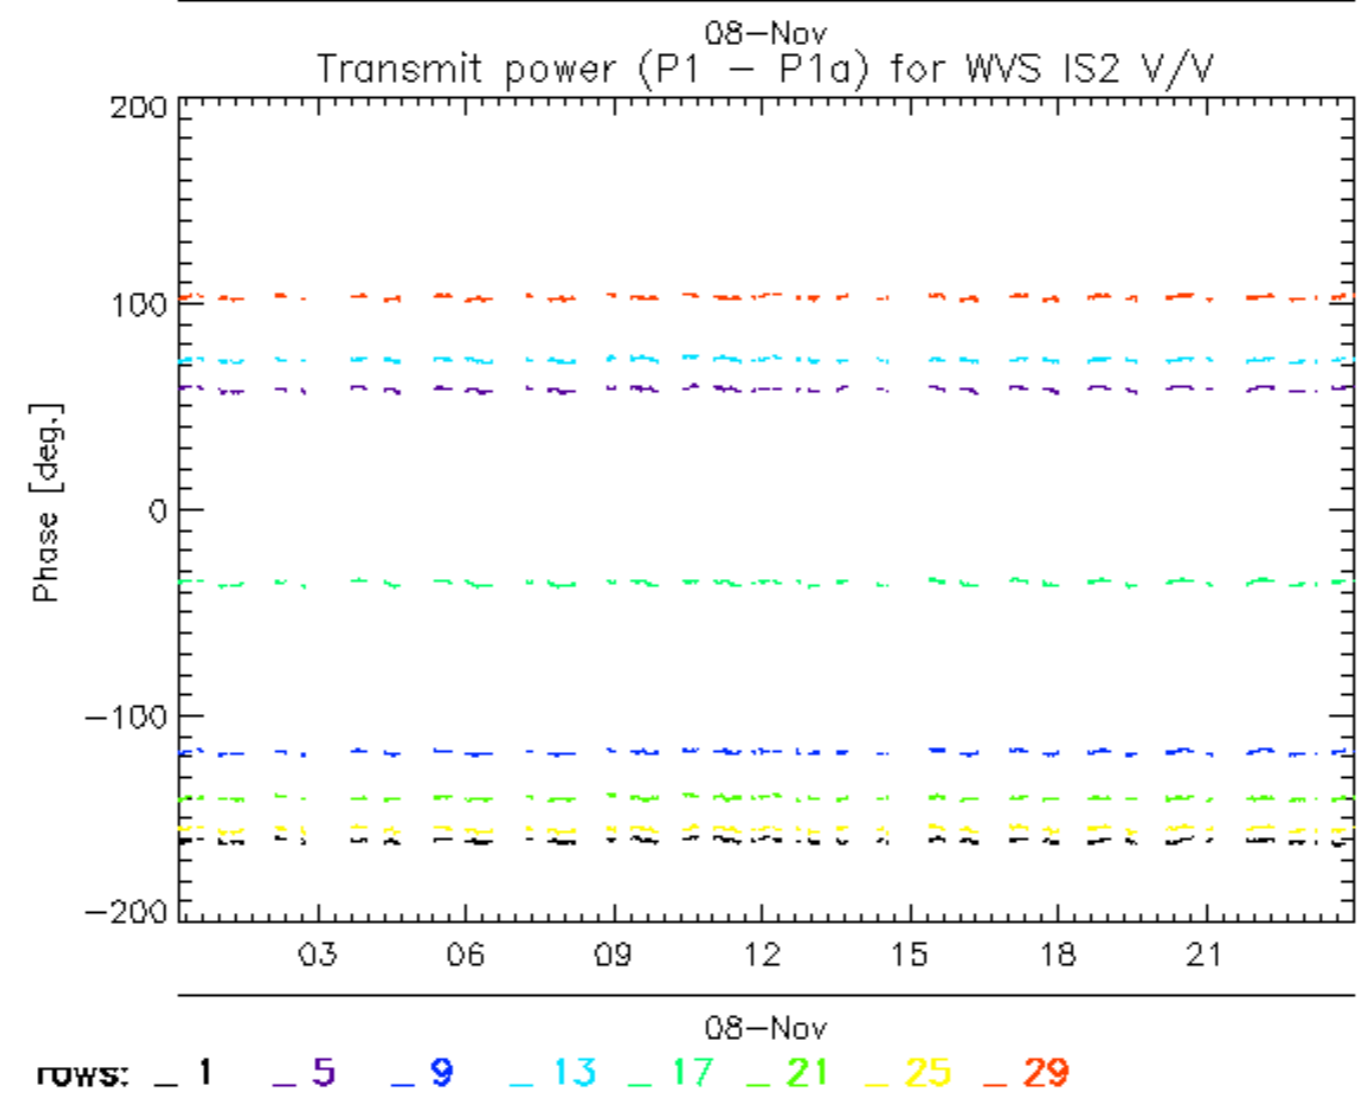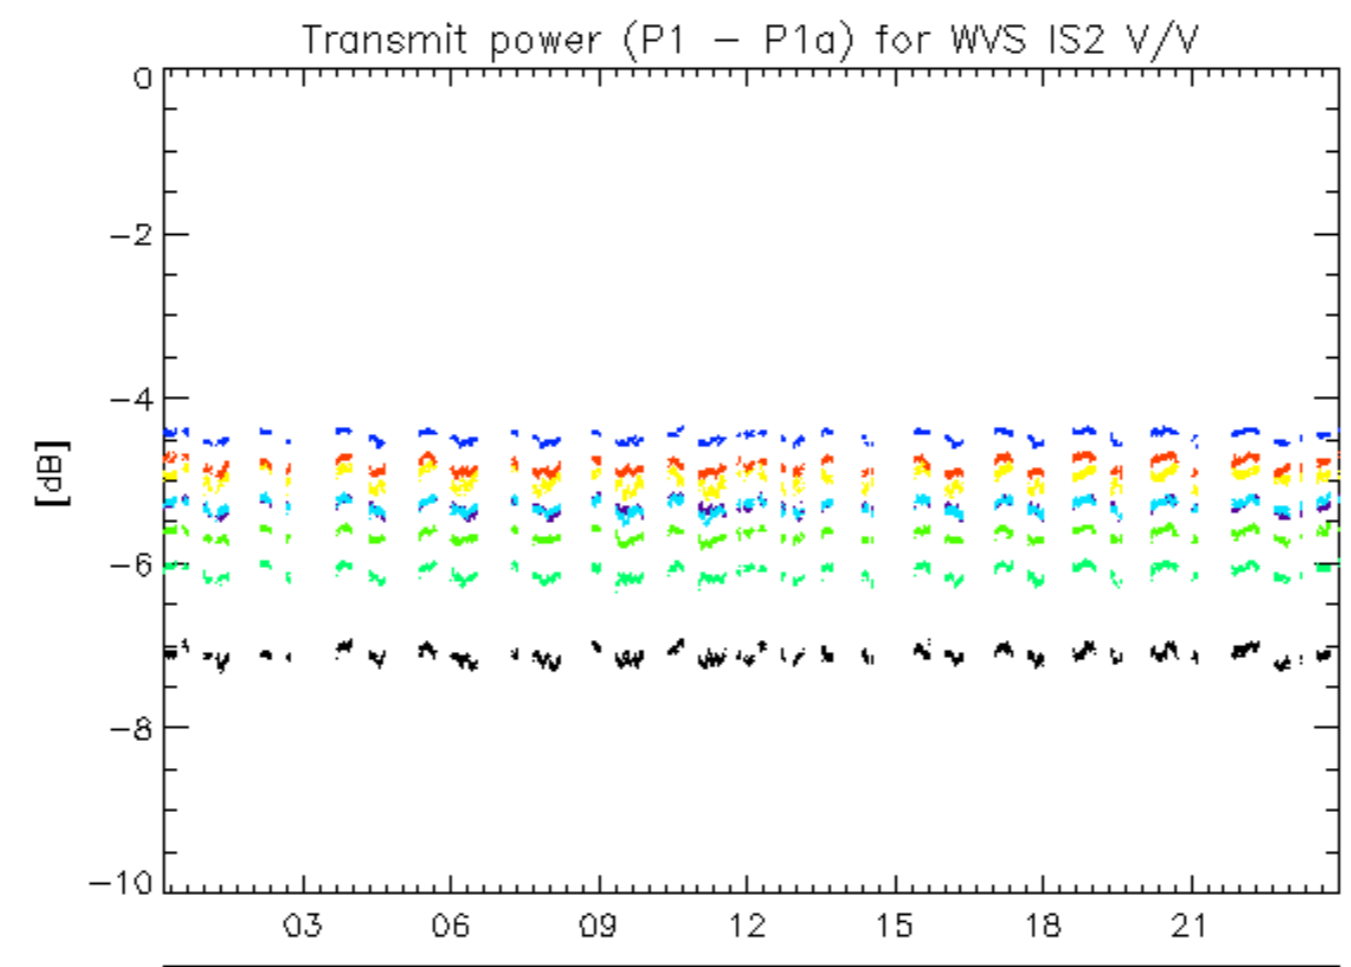

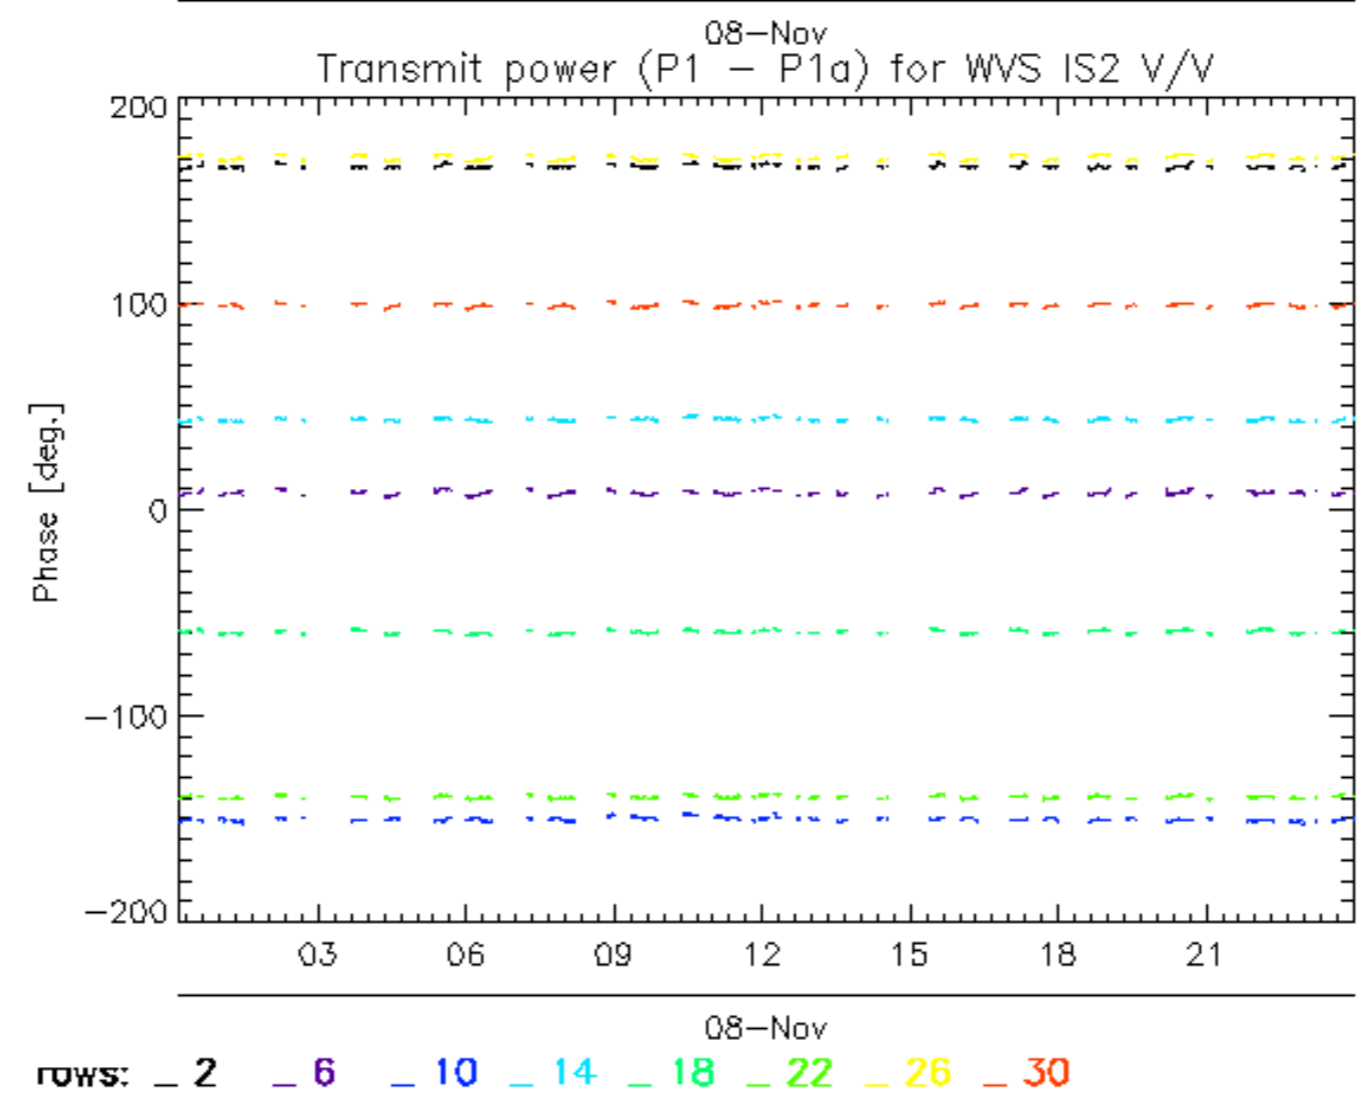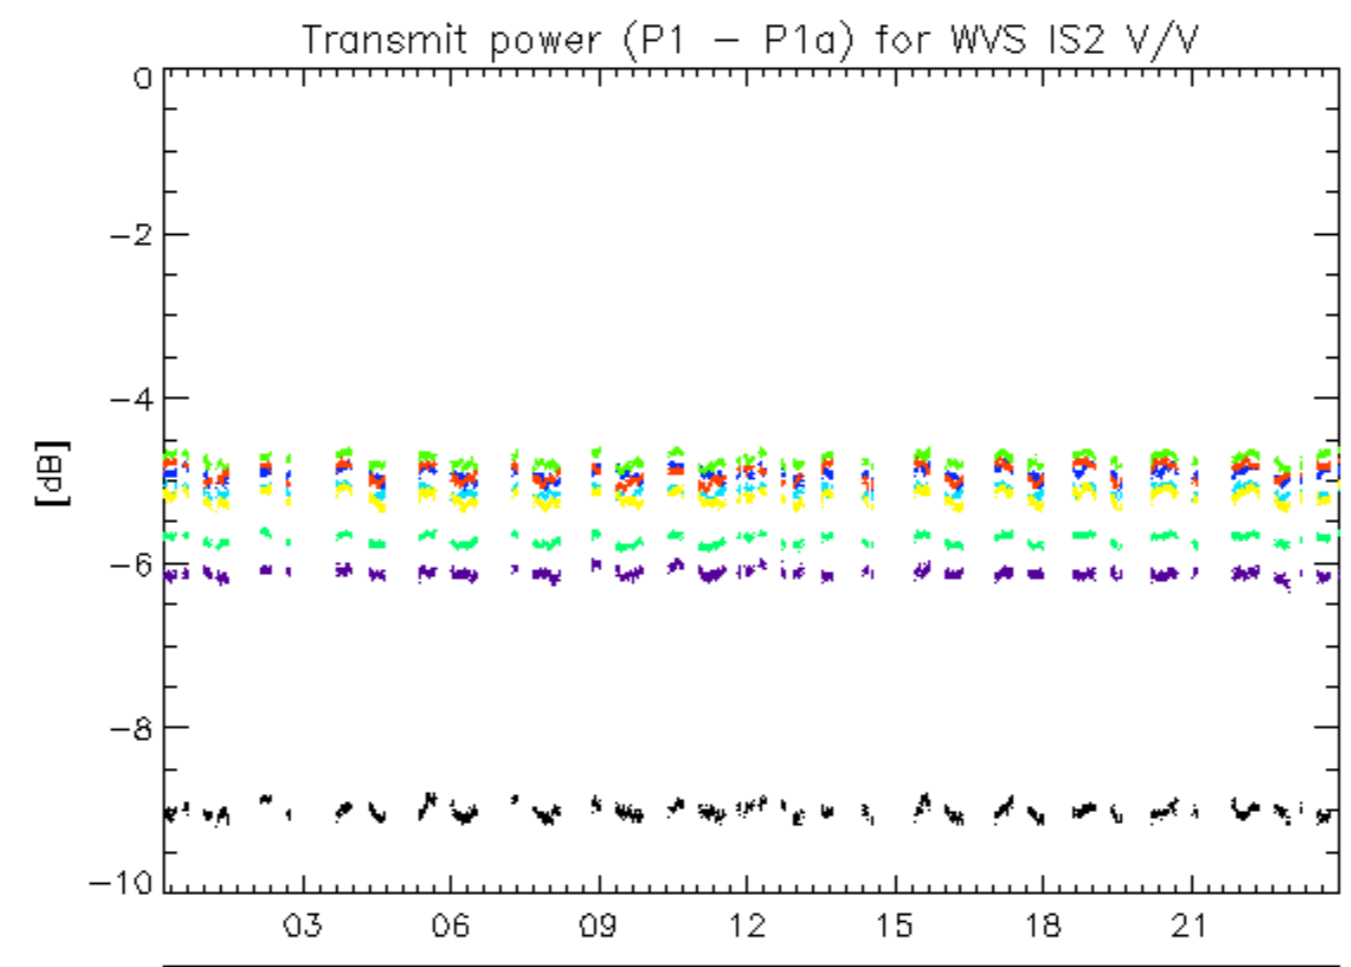


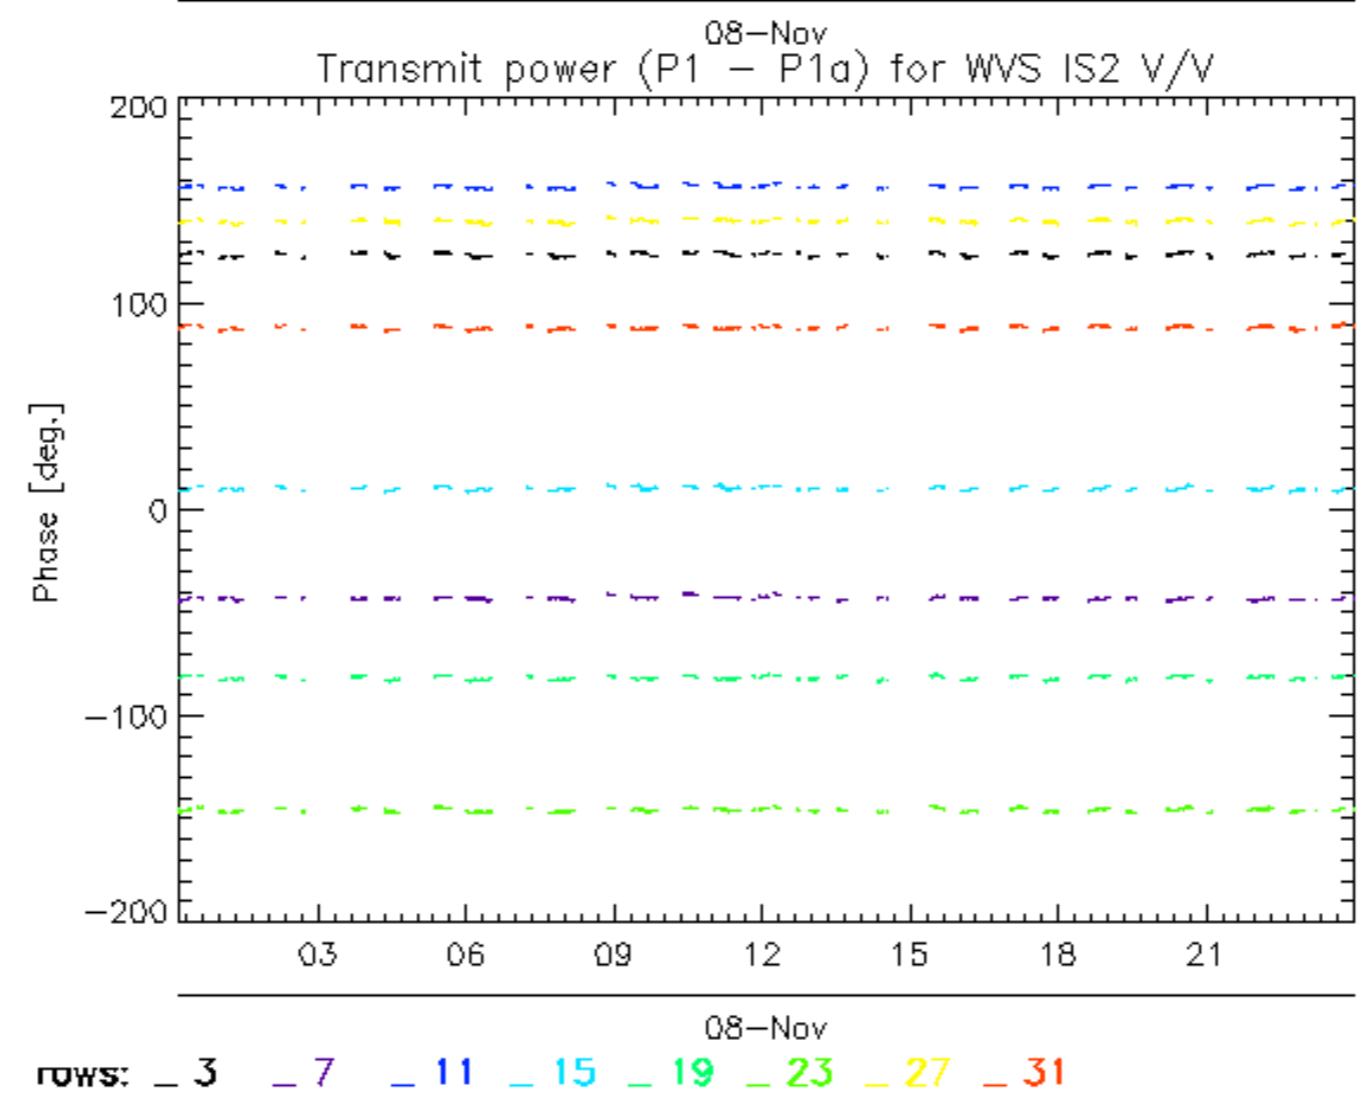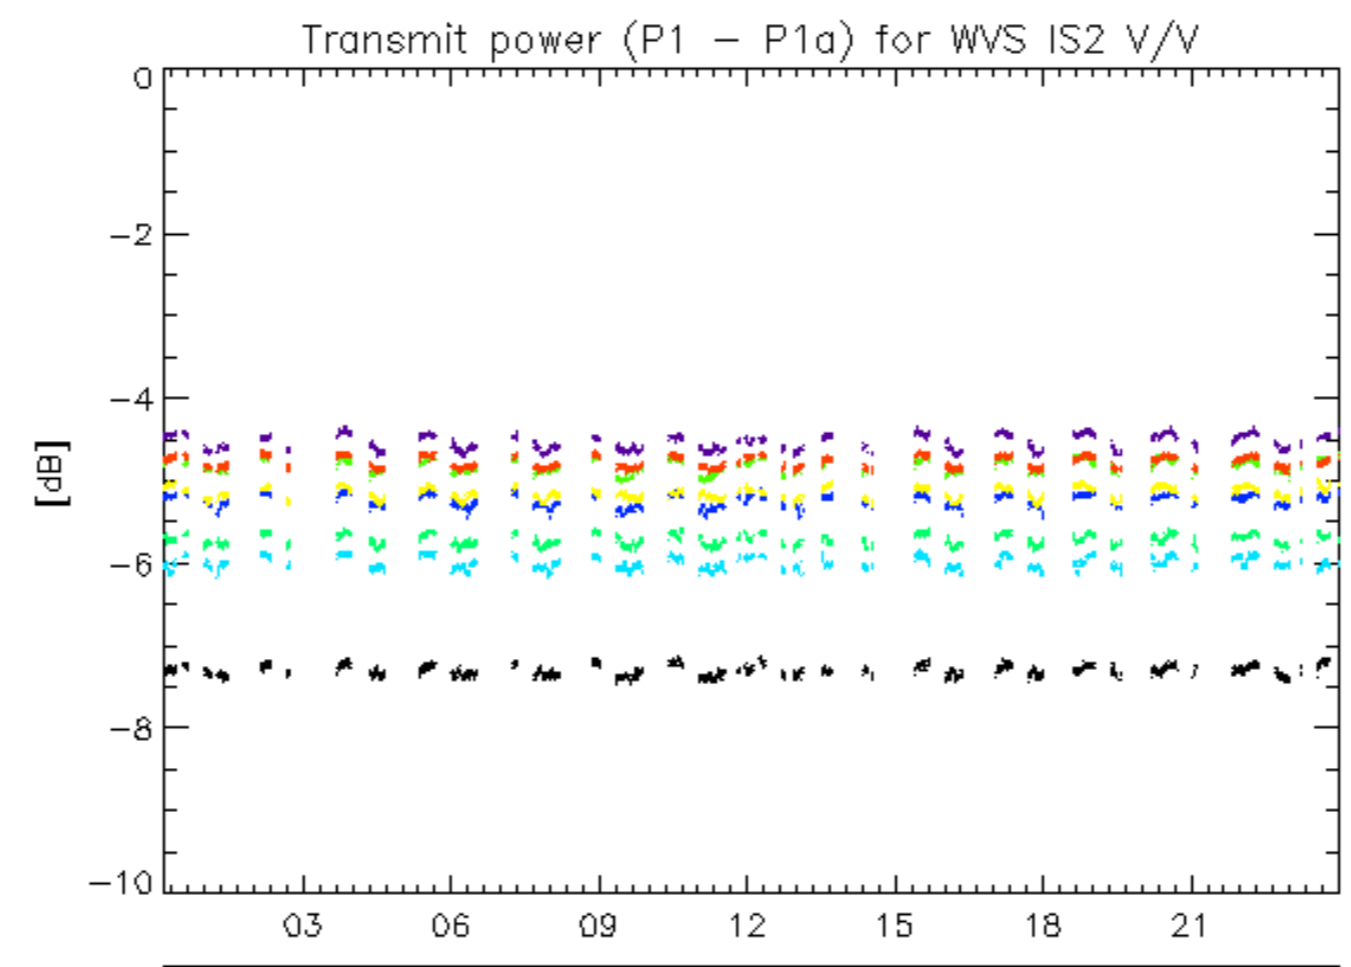


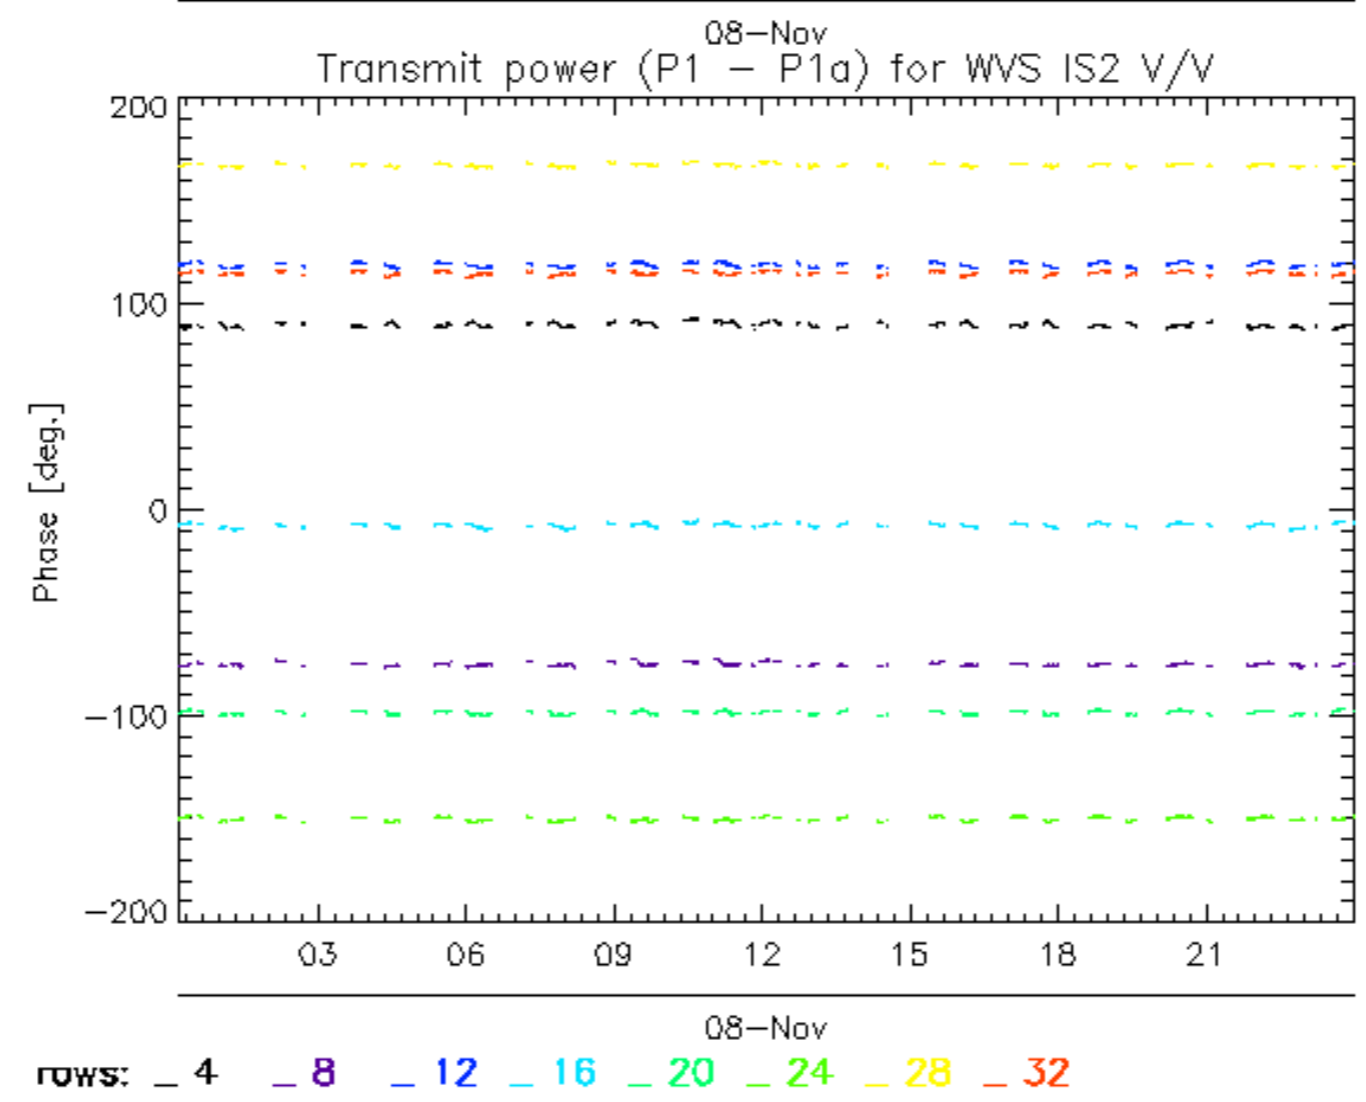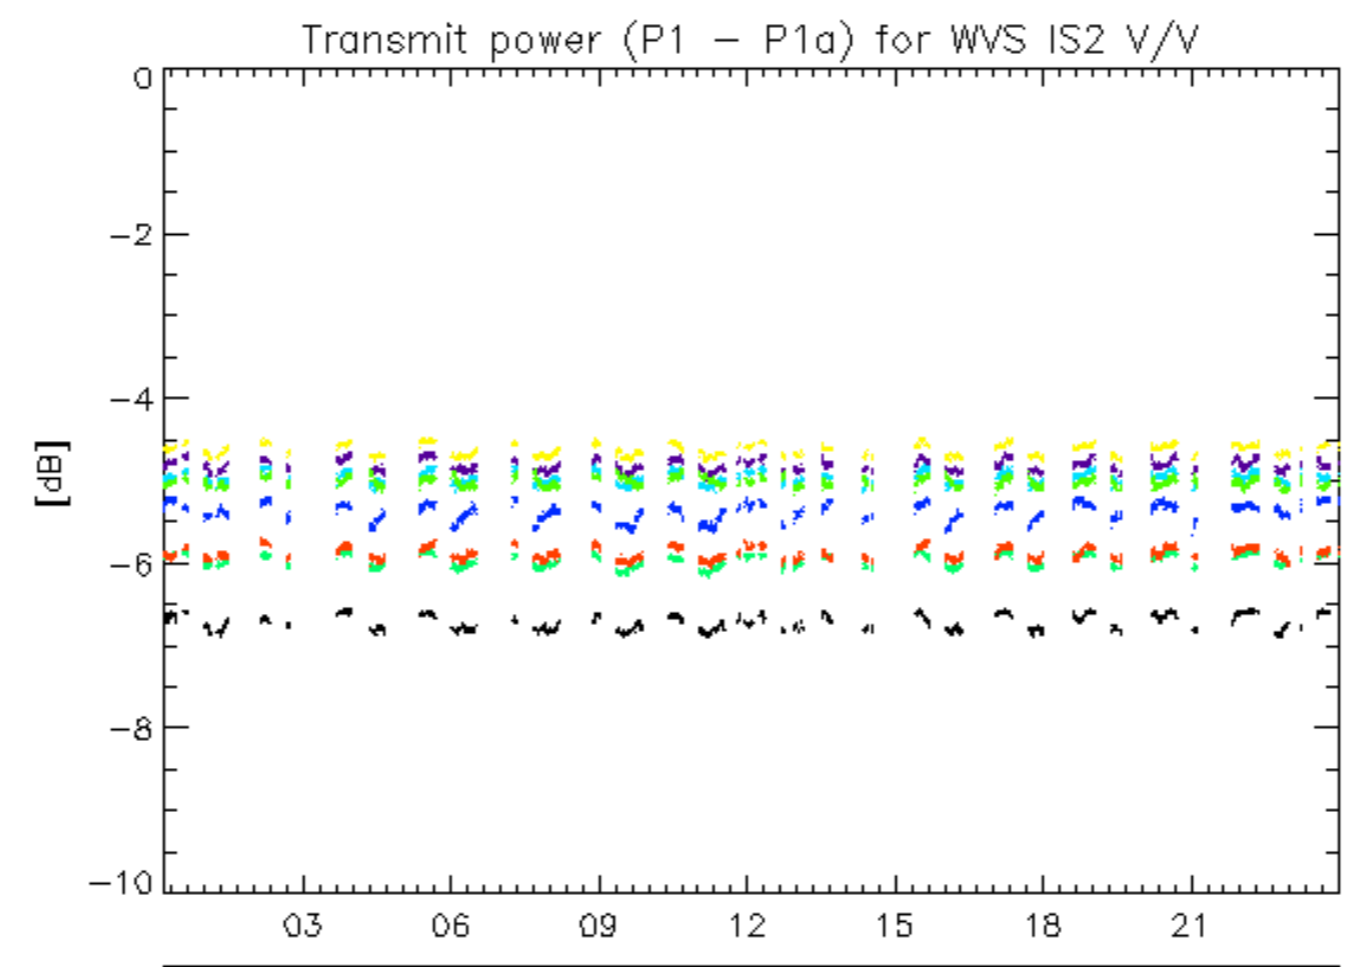


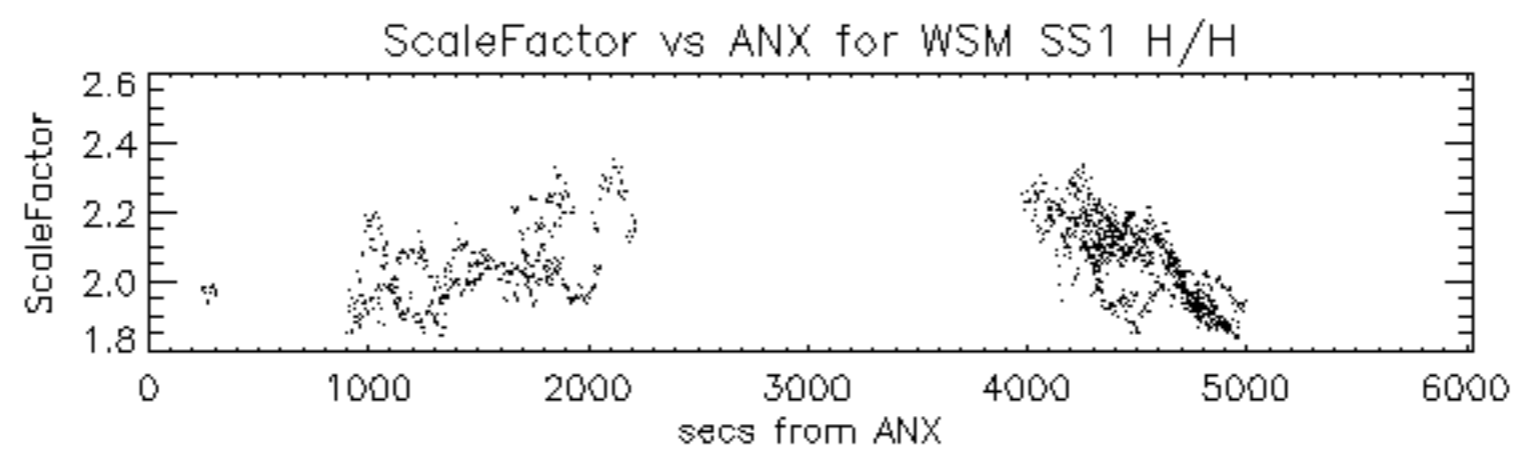



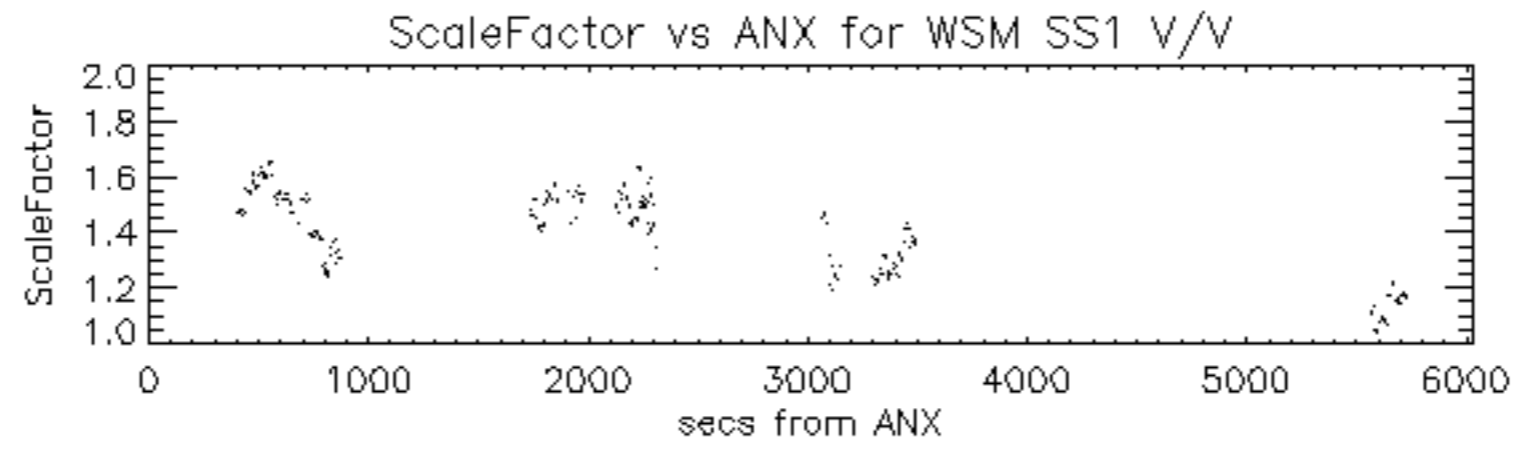

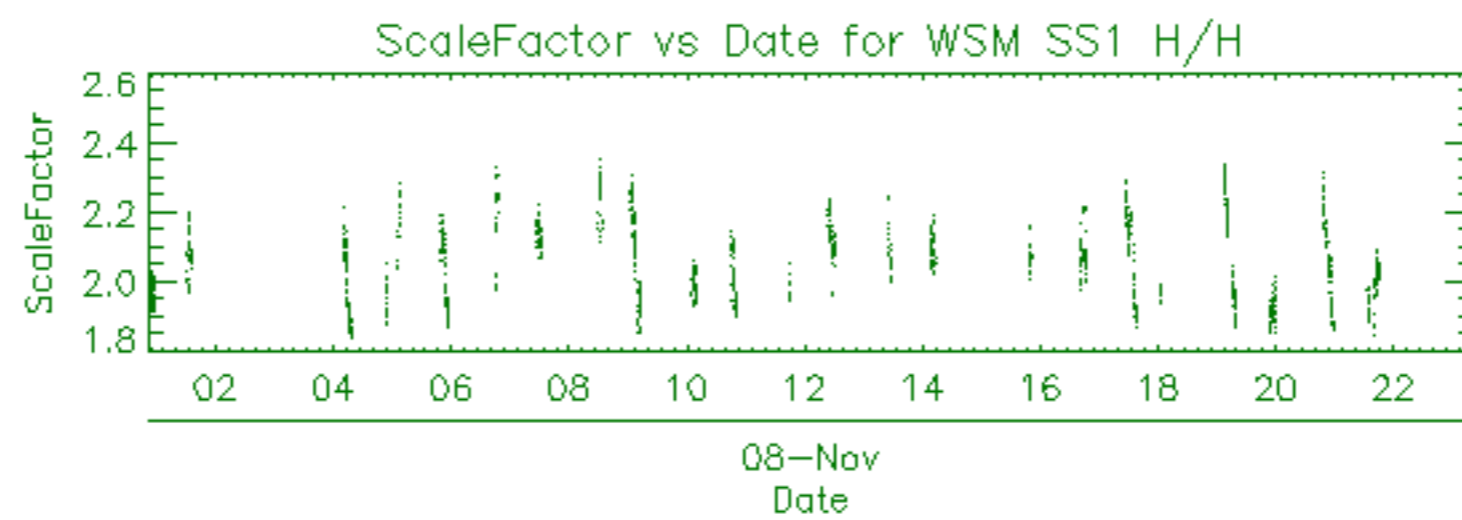

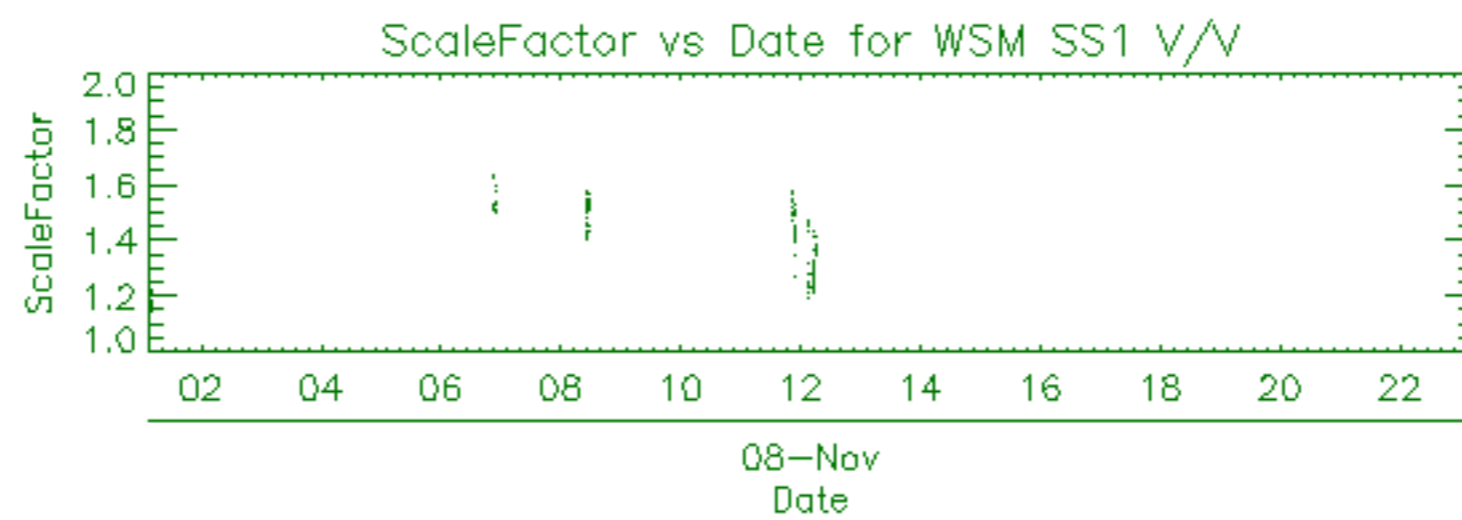

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_APM_1PNPDE20101108_020417_000000423096_00161_45434_4366.N1						IS4	V/H	96	45434	161	5.04
ASA_APM_1PNPDE20101108_020537_000000423096_00161_45434_4368.N1						IS4	V/H	96	45434	161	5.04
ASA_APM_1PNPDE20101108_070704_000000423096_00164_45437_4410.N1						IS4	V/H	96	45437	164	5.04
ASA_APM_1PNPDE20101108_150956_000000773096_00169_45442_4488.N1						IS1	H/H	96	45442	169	5.04
ASA_APM_1PNPDE20101108_165033_000000433096_00170_45443_4491.N1						IS1	H/H	96	45443	170	5.04
ASA_APM_1PNPDE20101108_182859_000001503096_00171_45444_4495.N1						IS1	H/H	96	45444	171	5.04

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_GM1_1PNPDE20101107_235752_000007373096_00160_45433_4336.N1						SS1	H/H	96	45433	160	5.04
ASA_GM1_1PNPDE20101108_002548_000001083096_00160_45433_4335.N1						SS1	H/H	96	45433	160	5.04
ASA_GM1_1PNPDE20101108_002835_000003443096_00160_45433_4339.N1						SS1	H/H	96	45433	160	5.04
ASA_GM1_1PNPDE20101108_004034_000000783096_00160_45433_4338.N1						SS1	H/H	96	45433	160	5.04
ASA_GM1_1PNPDE20101108_004316_000005073096_00160_45433_4342.N1						SS1	H/H	96	45433	160	5.04
ASA_GM1_1PNPDE20101108_011041_000002473096_00160_45433_4354.N1						SS1	H/H	96	45433	160	5.04
ASA_GM1_1PNPDE20101108_012922_000000783096_00161_45434_4355.N1						SS1	H/H	96	45434	161	5.04
ASA_GM1_1PNPDE20101108_013625_000010753096_00161_45434_4358.N1						SS1	H/H	96	45434	161	5.04
ASA_GM1_1PNPDE20101108_015731_000000663096_00161_45434_4357.N1						SS1	H/H	96	45434	161	5.04
ASA_GM1_1PNPDE20101108_015924_000000663096_00161_45434_4361.N1						SS1	H/H	96	45434	161	5.04
ASA_GM1_1PNPDE20101108_020640_000000663096_00161_45434_4359.N1						SS1	H/H	96	45434	161	5.04
ASA_GM1_1PNPDE20101108_022048_000011363096_00161_45434_4363.N1						SS1	H/H	96	45434	161	5.04
ASA_GM1_1PNPDE20101108_024410_000000963096_00161_45434_4364.N1						SS1	H/H	96	45434	161	5.04
ASA_GM1_1PNPDE20101108_024554_000004103096_00161_45434_4371.N1						SS1	H/H	96	45434	161	5.04
ASA_GM1_1PNPDE20101108_024554_000004103096_00161_45434_4372.N1						SS1	H/H	96	45434	161	5.04
ASA_GM1_1PNPDE20101108_025335_000013353096_00161_45434_4370.N1						SS1	H/H	96	45434	161	5.04
ASA_GM1_1PNPDE20101108_031656_000009433096_00162_45435_4381.N1						SS1	H/H	96	45435	162	5.04
ASA_GM1_1PNPDE20101108_033736_000002113096_00162_45435_4380.N1						SS1	H/H	96	45435	162	5.04
ASA_GM1_1PNPDE20101108_040200_000004653096_00162_45435_4398.N1						SS1	H/H	96	45435	162	5.04
ASA_GM1_1PNPDE20101108_041827_000001083096_00162_45435_4395.N1						SS1	H/H	96	45435	162	5.04
ASA_GM1_1PNPDE20101108_043934_000007913096_00163_45436_4394.N1						SS1	H/H	96	45436	163	5.04
ASA_GM1_1PNPDE20101108_045505_000006283096_00163_45436_4393.N1						SS1	H/H	96	45436	163	5.04
ASA_GM1_1PNPDE20101108_050810_000003503096_00163_45436_4392.N1						SS1	H/H	96	45436	163	5.04
ASA_GM1_1PNPDE20101108_051647_000002053096_00163_45436_4401.N1						SS1	H/H	96	45436	163	5.04
ASA_GM1_1PNPDE20101108_054117_000000783096_00163_45436_4411.N1						SS1	H/H	96	45436	163	5.04
ASA_GM1_1PNPDE20101108_054400_000002893096_00163_45436_4413.N1						SS1	H/H	96	45436	163	5.04
ASA_GM1_1PNPDE20101108_055724_000001693096_00163_45436_4414.N1						SS1	H/H	96	45436	163	5.04
ASA_GM1_1PNPDE20101108_063044_000008043096_00164_45437_4415.N1						SS1	H/H	96	45437	164	5.04
ASA_GM1_1PNPDE20101108_064745_000003023096_00164_45437_4416.N1						SS1	H/H	96	45437	164	5.04
ASA_GM1_1PNPDE20101108_065424_000007613096_00164_45437_4417.N1						SS1	H/H	96	45437	164	5.04
ASA_GM1_1PNPDE20101108_070806_000004163096_00164_45437_4422.N1						SS1	H/H	96	45437	164	5.04
ASA_GM1_1PNPDK20101108_072130_000003083096_00164_45437_9899.N1						SS1	H/H	96	45437	164	5.04
ASA_GM1_1PNPDK20101108_073220_000004893096_00164_45437_9897.N1						SS1	H/H	96	45437	164	5.04
ASA_GM1_1PNPDK20101108_081209_000007073096_00165_45438_9892.N1						SS1	H/H	96	45438	165	5.04
ASA_GM1_1PNPDK20101108_082248_000001143096_00165_45438_0092.N1						SS1	H/H	96	45438	165	5.04
ASA_GM1_1PNPDK20101108_083716_000001633096_00165_45438_0093.N1						SS1	H/H	96	45438	165	5.04
ASA_GM1_1PNPDK20101108_084431_000004043096_00165_45438_0094.N1						SS1	H/H	96	45438	165	5.04
ASA_GM1_1PNPDK20101108_091325_000004343096_00165_45438_0096.N1						SS1	H/H	96	45438	165	5.04
ASA_GM1_1PNPDK20101108_095326_000006283096_00166_45439_0097.N1						SS1	H/H	96	45439	166	5.04
ASA_GM1_1PNPDK20101108_100314_000000963096_00166_45439_0125.N1						SS1	H/H	96	45439	166	5.04
ASA_GM1_1PNPDK20101108_101209_000000963096_00166_45439_0126.N1						SS1	H/H	96	45439	166	5.04
ASA_GM1_1PNPDK20101108_102046_000002713096_00166_45439_0127.N1						SS1	H/H	96	45439	166	5.04
ASA_GM1_1PNPDK20101108_104159_000000783096_00166_45439_0128.N1						SS1	H/H	96	45439	166	5.04
ASA_GM1_1PNPDK20101108_105136_000005613096_00166_45439_0130.N1						SS1	H/H	96	45439	166	5.04
ASA_GM1_1PNPDK20101108_113300_000006163096_00167_45440_0136.N1						SS1	H/H	96	45440	167	5.04
ASA_GM1_1PNPDK20101108_114455_000002233096_00167_45440_0220.N1						SS1	H/H	96	45440	167	5.04
ASA_GM1_1PNPDK20101108_120920_000001203096_00167_45440_0222.N1						SS1	H/H	96	45440	167	5.04
ASA_GM1_1PNPDK20101108_122213_000000783096_00167_45440_0223.N1						SS1	H/H	96	45440	167	5.04
ASA_GM1_1PNPDK20101108_123119_000005923096_00167_45440_0225.N1						SS1	H/H	96	45440	167	5.04
ASA_GM1_1PNPDK20101108_124554_000000723096_00167_45440_0227.N1						SS1	H/H	96	45440	167	5.04
ASA_GM1_1PNPDK20101108_124718_000005313096_00167_45440_0230.N1						SS1	H/H	96	45440	167	5.04
ASA_GM1_1PNPDK20101108_130800_000009363096_00168_45441_0232.N1						SS1	H/H	96	45441	168	5.04
ASA_GM1_1PNPDK20101108_132222_000001503096_00168_45441_0276.N1						SS1	H/H	96	45441	168	5.04
ASA_GM1_1PNPDK20101108_132836_000000903096_00168_45441_0277.N1						SS1	H/H	96	45441	168	5.04
ASA_GM1_1PNPDK20101108_134424_000007073096_00168_45441_0278.N1						SS1	H/H	96	45441	168	5.04
ASA_GM1_1PNPDK20101108_135619_000006773096_00168_45441_0279.N1						SS1	H/H	96	45441	168	5.04
ASA_GM1_1PNPDK20101108_141317_000004893096_00168_45441_0283.N1						SS1	H/H	96	45441	168	5.04
ASA_GM1_1PNPDK20101108_142749_000002053096_00168_45441_0282.N1						SS1	H/H	96	45441	168	5.04
ASA_GM1_1PNPDK20101108_143401_000002293096_00168_45441_0284.N1						SS1	H/H	96	45441	168	5.04
ASA_GM1_1PNPDK20101108_144329_000010633096_00169_45442_0287.N1						SS1	H/H	96	45442	169	5.04
ASA_GM1_1PNPDK20101108_150003_000005923096_00169_45442_0325.N1						SS1	H/H	96	45442	169	5.04
ASA_GM1_1PNPDK20101108_151136_000001203096_00169_45442_0324.N1						SS1	H/H	96	45442	169	5.04
ASA_GM1_1PNPDK20101108_151520_000005553096_00169_45442_0327.N1						SS1	H/H	96	45442	169	5.04
ASA_GM1_1PNPDK20101108_154241_000000783096_00169_45442_0326.N1						SS1	H/H	96	45442	169	5.04
ASA_GM1_1PNPDK20101108_154525_000001933096_00169_45442_0328.N1						SS1	H/H	96	45442	169	5.04
ASA_GM1_1PNPDK20101108_155114_000006223096_00169_45442_0330.N1						SS1	H/H	96	45442	169	5.04
ASA_GM1_1PNPDK20101108_162213_000009913096_00170_45443_0332.N1						SS1	H/H	96	45443	170	5.04

ASA_GM1_1PNPDK20101108_163758_000001023096_00170_45443_0394.N1	SS1	H/H	96	45443	170	5.04
ASA_GM1_1PNPDK20101108_164714_000001993096_00170_45443_0393.N1	SS1	H/H	96	45443	170	5.04
ASA_GM1_1PNPDK20101108_165136_000006283096_00170_45443_0395.N1	SS1	H/H	96	45443	170	5.04
ASA_GM1_1PNPDK20101108_172257_000002473096_00170_45443_0402.N1	SS1	H/H	96	45443	170	5.04
ASA_GM1_1PNPDK20101108_172257_000002473096_00170_45443_0399.N1	SS1	H/H	96	45443	170	5.04
ASA_GM1_1PNPDK20101108_172257_000002473096_00170_45443_0401.N1	SS1	H/H	96	45443	170	5.04
ASA_GM1_1PNPDK20101108_173241_000001143096_00170_45443_0400.N1	SS1	H/H	96	45443	170	5.04
ASA_GM1_1PNPDK20101108_173241_000001143096_00170_45443_0403.N1	SS1	H/H	96	45443	170	5.04
ASA_GM1_1PNPDK20101108_173241_000001143096_00170_45443_0398.N1	SS1	H/H	96	45443	170	5.04
ASA_GM1_1PNPDK20101108_173803_000002293096_00170_45443_0396.N1	SS1	H/H	96	45443	170	5.04
ASA_GM1_1PNPDK20101108_180411_000007553096_00171_45444_0406.N1	SS1	H/H	96	45444	171	5.04
ASA_GM1_1PNPDK20101108_181532_000008103096_00171_45444_0437.N1	SS1	H/H	96	45444	171	5.04
ASA_GM1_1PNPDK20101108_183146_000002773096_00171_45444_0438.N1	SS1	H/H	96	45444	171	5.04
ASA_GM1_1PNPDK20101108_190310_000002293096_00171_45444_0439.N1	SS1	H/H	96	45444	171	5.04
ASA_GM1_1PNPDK20101108_191141_000001873096_00171_45444_0440.N1	SS1	H/H	96	45444	171	5.04
ASA_GM1_1PNPDK20101108_191948_000001323096_00171_45444_0443.N1	SS1	H/H	96	45444	171	5.04
ASA_GM1_1PNPDK20101108_193013_000001633096_00171_45444_0442.N1	SS1	H/H	96	45444	171	5.04
ASA_GM1_1PNPDK20101108_193558_000005313096_00171_45444_0445.N1	SS1	H/H	96	45444	171	5.04
ASA_GM1_1PNPDK20101108_195028_000001203096_00172_45445_0446.N1	SS1	H/H	96	45445	172	5.04
ASA_GM1_1PNPDE20101108_195413_000001083096_00172_45445_4505.N1	SS1	H/H	96	45445	172	5.04
ASA_GM1_1PNPDE20101108_200046_000006163096_00172_45445_4512.N1	SS1	H/H	96	45445	172	5.04
ASA_GM1_1PNPDE20101108_204323_000000783096_00172_45445_4511.N1	SS1	H/H	96	45445	172	5.04
ASA_GM1_1PNPDE20101108_204608_000000843096_00172_45445_4514.N1	SS1	H/H	96	45445	172	5.04
ASA_GM1_1PNPDE20101108_205116_000001503096_00172_45445_4513.N1	SS1	H/H	96	45445	172	5.04
ASA_GM1_1PNPDE20101108_205907_000001633096_00172_45445_4517.N1	SS1	H/H	96	45445	172	5.04
ASA_GM1_1PNPDE20101108_210035_000001023096_00172_45445_4531.N1	SS1	H/H	96	45445	172	5.04
ASA_GM1_1PNPDE20101108_210845_0000011423096_00172_45445_4532.N1	SS1	H/H	96	45445	172	5.04
ASA_GM1_1PNPDE20101108_213553_000002293096_00173_45446_4533.N1	SS1	H/H	96	45446	173	5.04
ASA_GM1_1PNPDE20101108_214714_000002233096_00173_45446_4535.N1	SS1	H/H	96	45446	173	5.04
ASA_GM1_1PNPDE20101108_222336_0000011363096_00173_45446_4538.N1	SS1	H/H	96	45446	173	5.04
ASA_GM1_1PNPDE20101108_225937_000003083096_00174_45447_4551.N1	SS1	H/H	96	45447	174	5.04
ASA_GM1_1PNPDE20101108_231628_000001143096_00174_45447_4549.N1	SS1	H/H	96	45447	174	5.04
ASA_GM1_1PNPDE20101108_232105_000007493096_00174_45447_4547.N1	SS1	H/H	96	45447	174	5.04
ASA_GM1_1PNPDE20101108_234854_000001323096_00174_45447_4552.N1	SS1	H/H	96	45447	174	5.04
ASA_GM1_1PNPDE20101108_235232_000003083096_00174_45447_4553.N1	SS1	H/H	96	45447	174	5.04
ASA_GM1_1PNPDE20101108_235743_000000783096_00174_45447_4555.N1	SS1	H/H	96	45447	174	5.04


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20101108_015432_000000993096_00161_45434_4365.N1						IS6	H/H	96	45434	161	5.04
ASA_IMM_1PNPDE20101108_025246_000000383096_00161_45434_4367.N1						IS7	V/V	96	45434	161	5.04
ASA_IMM_1PNPDE20101108_033239_000002853096_00162_45435_4352.N1						IS6	H/H	96	45435	162	5.04
ASA_IMM_1PNPDE20101108_051400_000001553096_00163_45436_4387.N1						IS6	H/H	96	45436	163	5.04
ASA_IMM_1PNPDE20101108_101719_000002003096_00166_45439_4442.N1						IS6	H/H	96	45439	166	5.04
ASA_IMM_1PNPDK20101108_130452_000000823096_00168_45441_0237.N1						IS6	H/H	96	45441	168	5.04
ASA_IMM_1PNPDK20101108_213205_000000373096_00173_45446_0515.N1						IS7	V/V	96	45446	173	5.04


Filename	Pol	Timestamp	count(Module)				
ASA_MS__0PNPDE20101108_004201_000000163096_00160_45433_0051.N1	V			2010-11-08	00:42:01	320	
ASA_MS__0PNPDE20101108_054243_000000163096_00163_45436_0052.N1	H			2010-11-08	05:42:43	320	
ASA_MS__0PNPDK20101108_104325_000000163096_00166_45439_0273.N1	V			2010-11-08	10:43:25	320	
ASA_MS__0PNPDK20101108_154407_000000163096_00169_45442_0274.N1	H			2010-11-08	15:44:07	320	
ASA_MS__0PNPDE20101108_204449_000000163096_00172_45445_0053.N1	V			2010-11-08	20:44:49	320	





Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WSM_1PNPDE20101108_005150_000003923096_00160_45433_4348.N1						SS1	H/H	96	45433	160	5.04
ASA_WSM_1PNPDE20101108_010731_000001843096_00160_45433_4350.N1						SS1	V/V	96	45433	160	5.04
ASA_WSM_1PNPDE20101108_013050_000003303096_00161_45434_4356.N1						SS1	H/H	96	45434	161	5.04
ASA_WSM_1PNPDE20101108_040950_000005143096_00162_45435_4391.N1						SS1	H/H	96	45435	162	5.04
ASA_WSM_1PNPDE20101108_045250_000001283096_00163_45436_4396.N1						SS1	H/H	96	45436	163	5.04
ASA_WSM_1PNPDE20101108_050537_000001353096_00163_45436_4386.N1						SS1	H/H	96	45436	163	5.04
ASA_WSM_1PNPDE20101108_054850_000005143096_00163_45436_4428.N1						SS1	H/H	96	45436	163	5.04
ASA_WSM_1PNPDK20101108_064411_000002083096_00164_45437_9900.N1						SS1	H/H	96	45437	164	5.04
ASA_WSM_1PNPDE20101108_065249_000000923096_00164_45437_4409.N1						SS1	V/V	96	45437	164	5.04
ASA_WSM_1PNPDE20101108_072643_000001103096_00164_45437_4429.N1						SS1	H/H	96	45437	164	5.04
ASA_WSM_1PNPDK20101108_072843_000002083096_00164_45437_9893.N1						SS1	H/H	96	45437	164	5.04
ASA_WSM_1PNPDK20101108_072843_000002083096_00164_45437_9894.N1						SS1	H/H	96	45437	164	5.04
ASA_WSM_1PNPDE20101108_082450_000001533096_00165_45438_4434.N1						SS1	V/V	96	45438	165	5.04
ASA_WSM_1PNPDK20101108_082750_000000923096_00165_45438_0004.N1						SS1	V/V	96	45438	165	5.04
ASA_WSM_1PNPDK20101108_082939_000002143096_00165_45438_0005.N1						SS1	H/H	96	45438	165	5.04
ASA_WSM_1PNPDK20101108_090213_000003923096_00165_45438_0105.N1						SS1	H/H	96	45438	165	5.04
ASA_WSM_1PNPDK20101108_090950_000002083096_00165_45438_0104.N1						SS1	H/H	96	45438	165	5.04
ASA_WSM_1PNPDE20101108_100458_000003553096_00166_45439_4441.N1						SS1	H/H	96	45439	166	5.04
ASA_WSM_1PNPDE20101108_104459_000003923096_00166_45439_4448.N1						SS1	H/H	96	45439	166	5.04
ASA_WSM_1PNPDK20101108_114318_000000923096_00167_45440_0134.N1						SS1	H/H	96	45440	167	5.04
ASA_WSM_1PNPDE20101108_115149_000002143096_00167_45440_4457.N1						SS1	V/V	96	45440	167	5.04
ASA_WSM_1PNPDE20101108_120730_000001043096_00167_45440_4458.N1						SS1	V/V	96	45440	167	5.04
ASA_WSM_1PNPDE20101108_121124_000002143096_00167_45440_4459.N1						SS1	V/V	96	45440	167	5.04
ASA_WSM_1PNPDE20101108_122339_000002143096_00167_45440_4460.N1						SS1	H/H	96	45440	167	5.04
ASA_WSM_1PNPDK20101108_122739_000002143096_00167_45440_0233.N1						SS1	H/H	96	45440	167	5.04
ASA_WSM_1PNPDK20101108_132459_000002083096_00168_45441_0240.N1						SS1	H/H	96	45441	168	5.04
ASA_WSM_1PNPDK20101108_140738_000003303096_00168_45441_4485.N1						SS1	H/H	96	45441	168	5.04
ASA_WSM_1PNPDE20101108_154839_000001473096_00169_45442_4486.N1						SS1	H/H	96	45442	169	5.04
ASA_WSM_1PNPDK20101108_163951_000002083096_00170_45443_0339.N1						SS1	H/H	96	45443	170	5.04
ASA_WSM_1PNPDE20101108_164439_000001533096_00170_45443_4489.N1						SS1	H/H	96	45443	170	5.04
ASA_WSM_1PNPDE20101108_172707_000003123096_00170_45443_4492.N1						SS1	H/H	96	45443	170	5.04
ASA_WSM_1PNPDE20101108_173441_000001903096_00170_45443_4490.N1						SS1	H/H	96	45443	170	5.04
ASA_WSM_1PNPDE20101108_180122_000000923096_00171_45444_4493.N1						SS1	H/H	96	45444	171	5.04
ASA_WSM_1PNPDE20101108_190705_000002693096_00171_45444_4496.N1						SS1	H/H	96	45444	171	5.04
ASA_WSM_1PNPDE20101108_191449_000003003096_00171_45444_4494.N1						SS1	H/H	96	45444	171	5.04
ASA_WSM_1PNPDK20101108_195237_000000923096_00172_45445_0449.N1						SS1	H/H	96	45445	172	5.04
ASA_WSM_1PNPDK20101108_195237_000000923096_00172_45445_0448.N1						SS1	H/H	96	45445	172	5.04
ASA_WSM_1PNPDK20101108_195606_000002753096_00172_45445_0456.N1						SS1	H/H	96	45445	172	5.04
ASA_WSM_1PNPDE20101108_204743_000002143096_00172_45445_4523.N1						SS1	H/H	96	45445	172	5.04
ASA_WSM_1PNPDE20101108_205350_000003123096_00172_45445_4524.N1						SS1	H/H	96	45445	172	5.04
ASA_WSM_1PNPDK20101108_213307_000001533096_00173_45446_0516.N1						SS1	H/H	96	45446	173	5.04
ASA_WSM_1PNPDE20101108_213949_000004343096_00173_45446_4539.N1						SS1	H/H	96	45446	173	5.04
ASA_WSM_1PNPDE20101108_230447_000002753096_00174_45447_4544.N1						SS1	V/V	96	45447	174	5.04
ASA_WSM_1PNPDE20101108_230926_000002083096_00174_45447_4545.N1						SS1	V/V	96	45447	174	5.04
ASA_WSM_1PNPDK20101108_231451_000000923096_00174_45447_0544.N1						SS1	H/H	96	45447	174	5.04
ASA_WSM_1PNPDK20101108_231831_000001533096_00174_45447_0545.N1						SS1	H/H	96	45447	174	5.04




Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20101108_001010_000008993096_00160_45433_4337.N1						IS2	V/V	96	45433	160	5.04
ASA_WVS_1PNPDE20101108_003418_000003303096_00160_45433_4340.N1						IS2	V/V	96	45433	160	5.04
ASA_WVS_1PNPDE20101108_005924_000002543096_00160_45433_4341.N1						IS2	V/V	96	45433	160	5.04
ASA_WVS_1PNPDE20101108_010239_000002553096_00160_45433_4353.N1						IS2	V/V	96	45433	160	5.04
ASA_WVS_1PNPDE20101108_005924_000002543096_00160_45433_4341.N1						IS1	V/V	96	45433	160	5.04
ASA_WVS_1PNPDE20101108_011451_000008243096_00160_45433_4360.N1						IS2	V/V	96	45433	160	5.04
ASA_WVS_1PNPDE20101108_020754_000007343096_00161_45434_4362.N1						IS2	V/V	96	45434	161	5.04
ASA_WVS_1PNPDE20101108_023947_000002253096_00161_45434_4379.N1						IS2	V/V	96	45434	161	5.04
ASA_WVS_1PNPDE20101108_034111_000007793096_00162_45435_4378.N1						IS2	V/V	96	45435	162	5.04
ASA_WVS_1PNPDE20101108_035356_000002403096_00162_45435_4397.N1						IS2	V/V	96	45435	162	5.04
ASA_WVS_1PNPDE20101108_042020_000011093096_00162_45435_4399.N1						IS2	V/V	96	45435	162	5.04
ASA_WVS_1PNPDE20101108_052011_000010193096_00163_45436_4400.N1						IS2	V/V	96	45436	163	5.04
ASA_WVS_1PNPDE20101108_053656_000002103096_00163_45436_4412.N1						IS2	V/V	96	45436	163	5.04
ASA_WVS_1PNPDE20101108_060015_000017843096_00163_45436_4418.N1						IS2	V/V	96	45436	163	5.04
ASA_WVS_1PNPDE20101108_071503_000001953096_00164_45437_4421.N1						IS2	V/V	96	45437	164	5.04
ASA_WVS_1PNPDK20101108_071803_000001653096_00164_45437_9898.N1						IS2	V/V	96	45437	164	5.04
ASA_WVS_1PNPDE20101108_071503_000001953096_00164_45437_4421.N1						IS1	V/V	96	45437	164	5.04
ASA_WVS_1PNPDK20101108_074029_000018593096_00164_45437_9895.N1						IS2	V/V	96	45437	164	5.04
ASA_WVS_1PNPDK20101108_085116_000005853096_00165_45438_0095.N1						IS2	V/V	96	45438	165	5.04
ASA_WVS_1PNPDK20101108_092043_000019193096_00165_45438_0098.N1						IS2	V/V	96	45438	165	5.04
ASA_WVS_1PNPDK20101108_102519_000009593096_00166_45439_0129.N1						IS2	V/V	96	45439	166	5.04
ASA_WVS_1PNPDK20101108_110057_000018743096_00166_45439_0148.N1						IS2	V/V	96	45439	166	5.04
ASA_WVS_1PNPDK20101108_114843_000001503096_00167_45440_0219.N1						IS2	V/V	96	45440	167	5.04
ASA_WVS_1PNPDK20101108_115721_000005693096_00167_45440_0221.N1						IS2	V/V	96	45440	167	5.04
ASA_WVS_1PNPDK20101108_121455_000003903096_00167_45440_0224.N1						IS2	V/V	96	45440	167	5.04
ASA_WVS_1PNPDK20101108_124111_000002403096_00167_45440_0226.N1						IS2	V/V	96	45440	167	5.04
ASA_WVS_1PNPDK20101108_125610_000004873096_00167_45440_0229.N1						IS2	V/V	96	45440	167	5.04
ASA_WVS_1PNPDK20101108_130620_00000593096_00168_45441_0231.N1						IS2	V/V	96	45441	168	5.04
ASA_WVS_1PNPDK20101108_133014_000008093096_00168_45441_0280.N1						IS2	V/V	96	45441	168	5.04
ASA_WVS_1PNPDK20101108_142125_000003003096_00168_45441_0281.N1						IS2	V/V	96	45441	168	5.04
ASA_WVS_1PNPDK20101108_143116_000001193096_00168_45441_0286.N1						IS2	V/V	96	45441	168	5.04
ASA_WVS_1PNPDK20101108_143116_000001193096_00168_45441_0285.N1						IS2	V/V	96	45441	168	5.04
ASA_WVS_1PNPDK20101108_152440_000010343096_00169_45442_0329.N1						IS2	V/V	96	45442	169	5.04
ASA_WVS_1PNPDK20101108_160139_000011843096_00169_45442_0331.N1						IS2	V/V	96	45442	169	5.04
ASA_WVS_1PNPDK20101108_170209_000011993096_00170_45443_0397.N1						IS2	V/V	96	45443	170	5.04
ASA_WVS_1PNPDK20101108_174154_000011243096_00170_45443_0409.N1						IS2	V/V	96	45443	170	5.04
ASA_WVS_1PNPDK20101108_183624_000015593096_00171_45444_0441.N1						IS2	V/V	96	45444	171	5.04
ASA_WVS_1PNPDK20101108_192208_000004503096_00171_45444_0444.N1						IS2	V/V	96	45444	171	5.04
ASA_WVS_1PNPDK20101108_193300_000001343096_00171_45444_0447.N1						IS2	V/V	96	45444	171	5.04
ASA_WVS_1PNPDE20101108_201106_000018893096_00172_45445_4516.N1						IS2	V/V	96	45445	172	5.04
ASA_WVS_1PNPDE20101108_210222_000003003096_00172_45445_4534.N1						IS2	V/V	96	45445	172	5.04
ASA_WVS_1PNPDE20101108_215057_000019193096_00173_45446_4536.N1						IS2	V/V	96	45446	173	5.04
ASA_WVS_1PNPDE20101108_224236_000003303096_00173_45446_4537.N1						IS2	V/V	96	45446	173	5.04
ASA_WVS_1PNPDE20101108_224706_000007043096_00173_45446_4550.N1						IS2	V/V	96	45446	173	5.04
ASA_WVS_1PNPDE20101108_231256_00000753096_00174_45447_4548.N1						IS2	V/V	96	45447	174	5.04
ASA_WVS_1PNPDE20101108_233336_000008843096_00174_45447_4554.N1						IS2	V/V	96	45447	174	5.04
ASA_WVS_1PNPDE20101108_235908_000002403096_00174_45447_4557.N1						IS2	V/V	96	45447	174	5.04



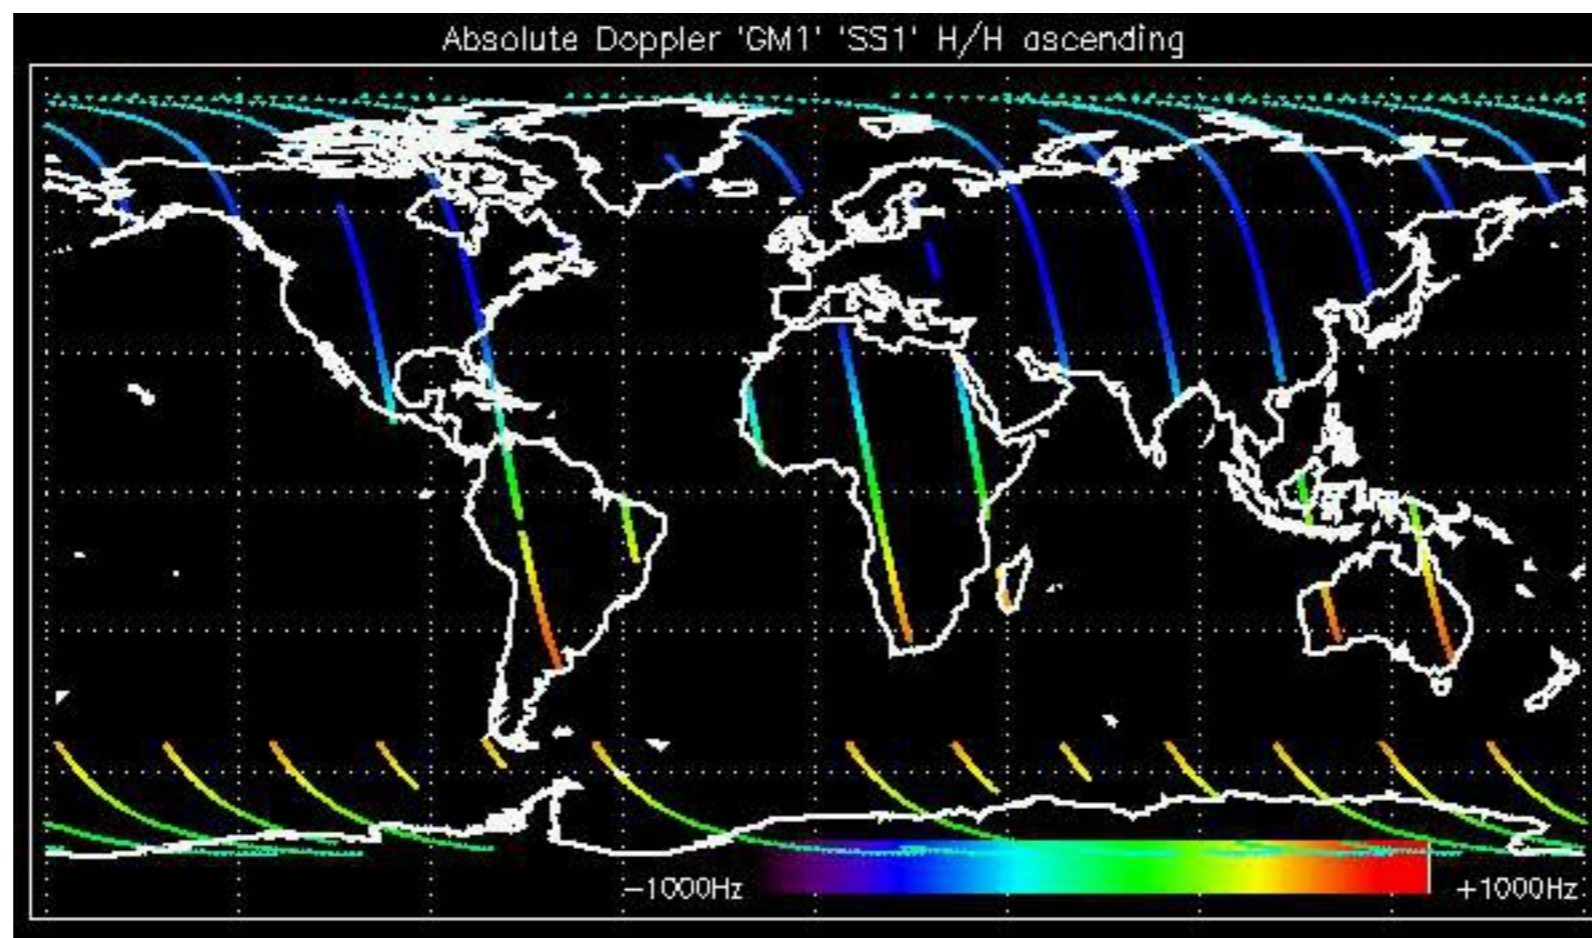


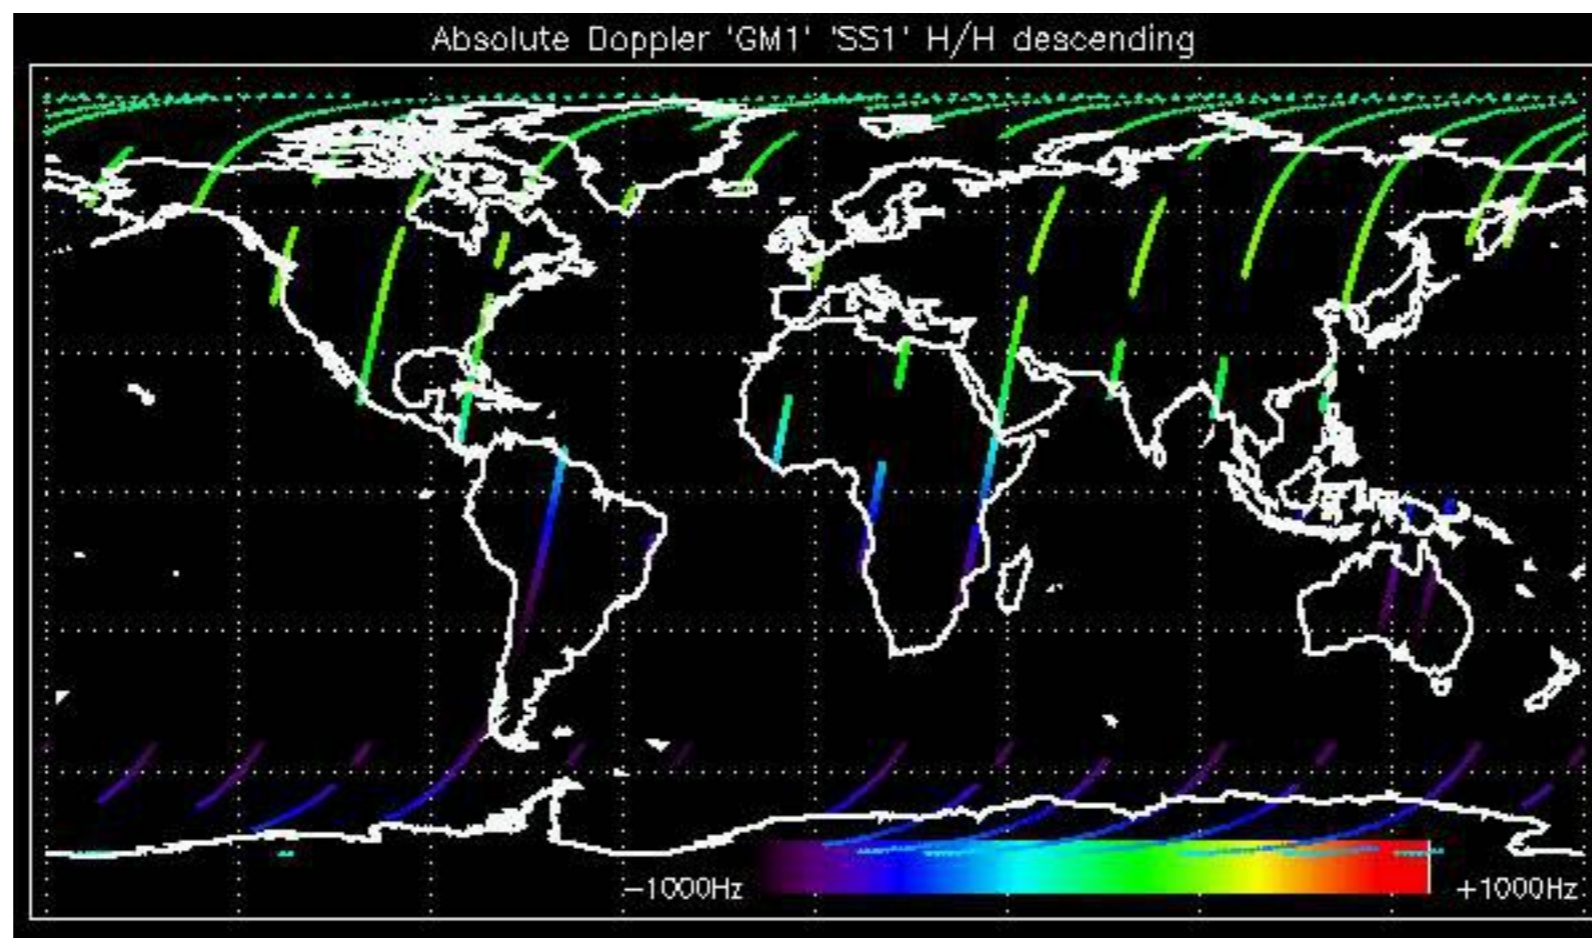

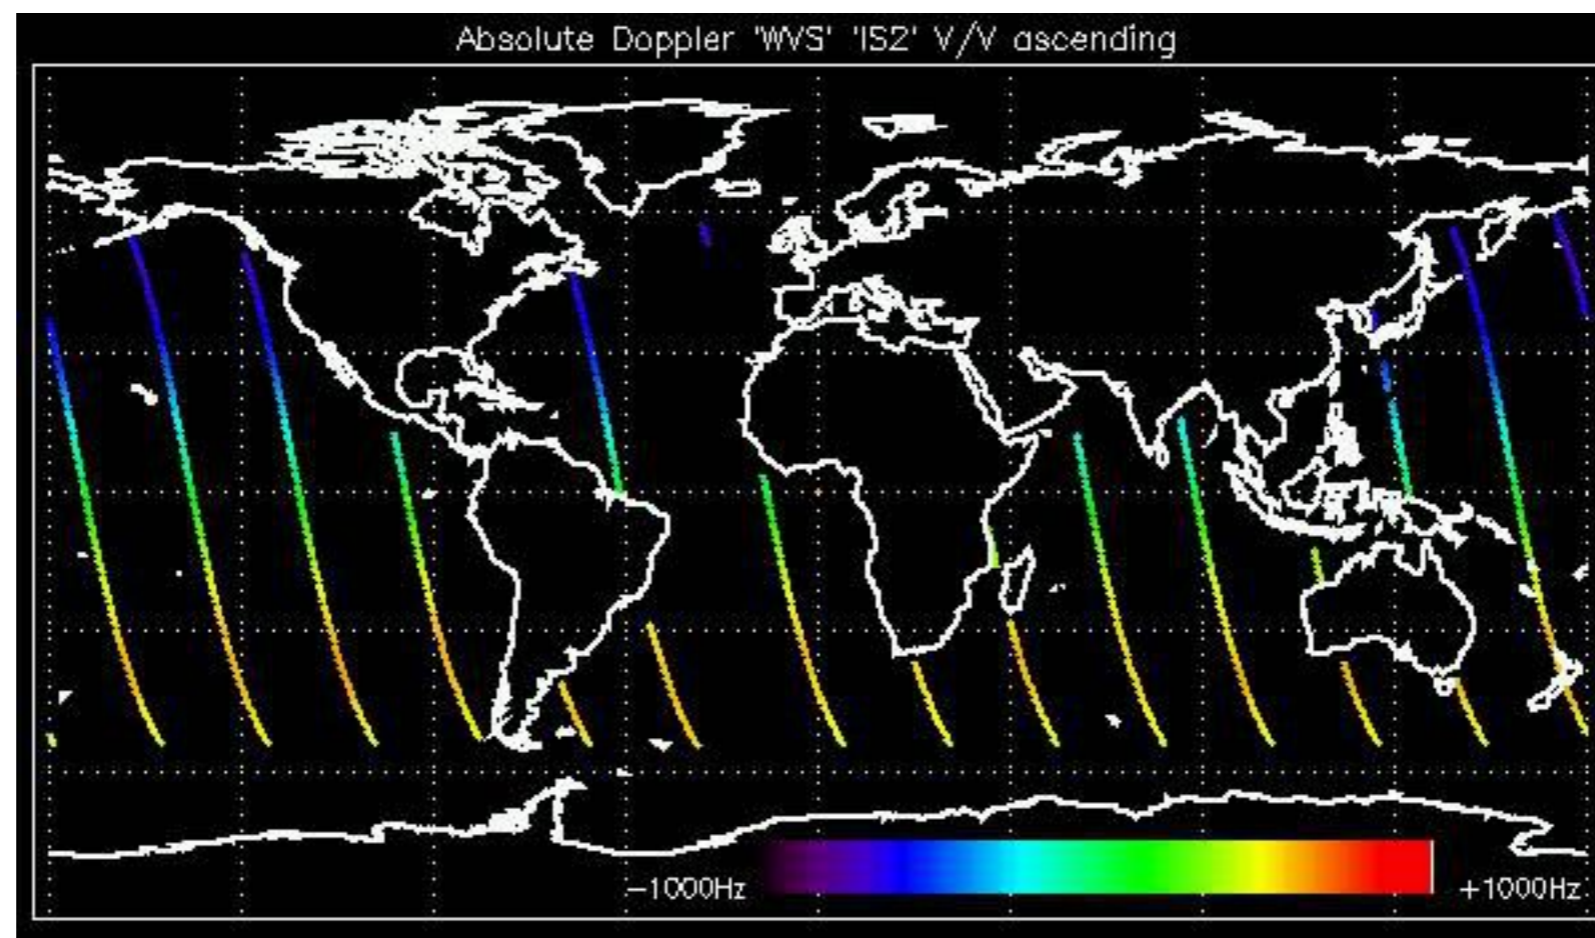


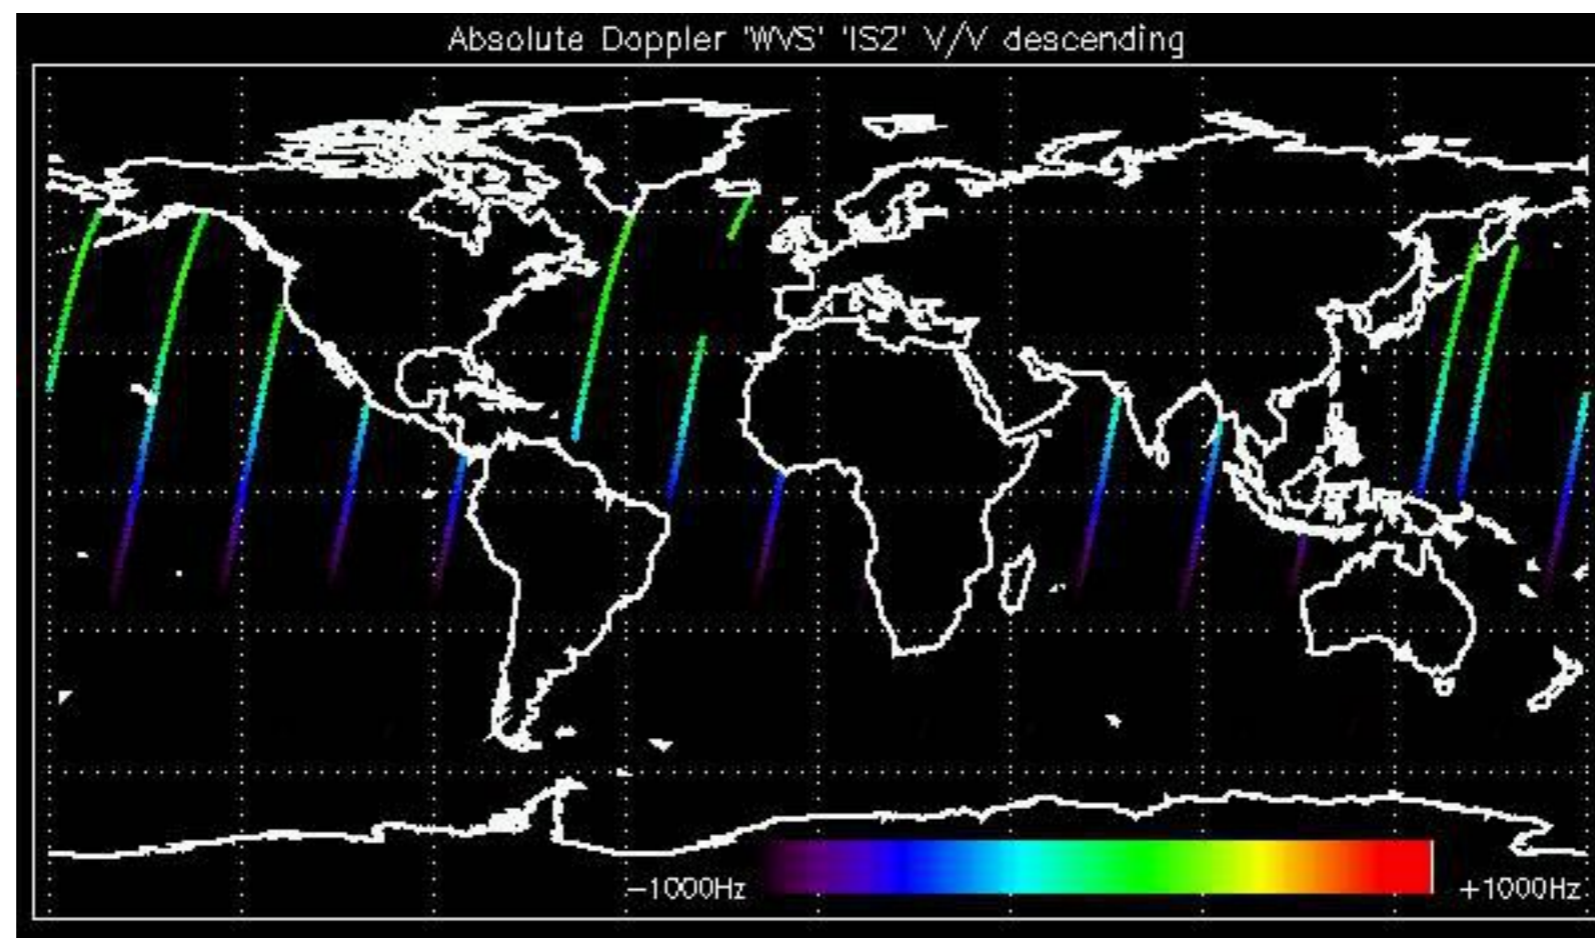


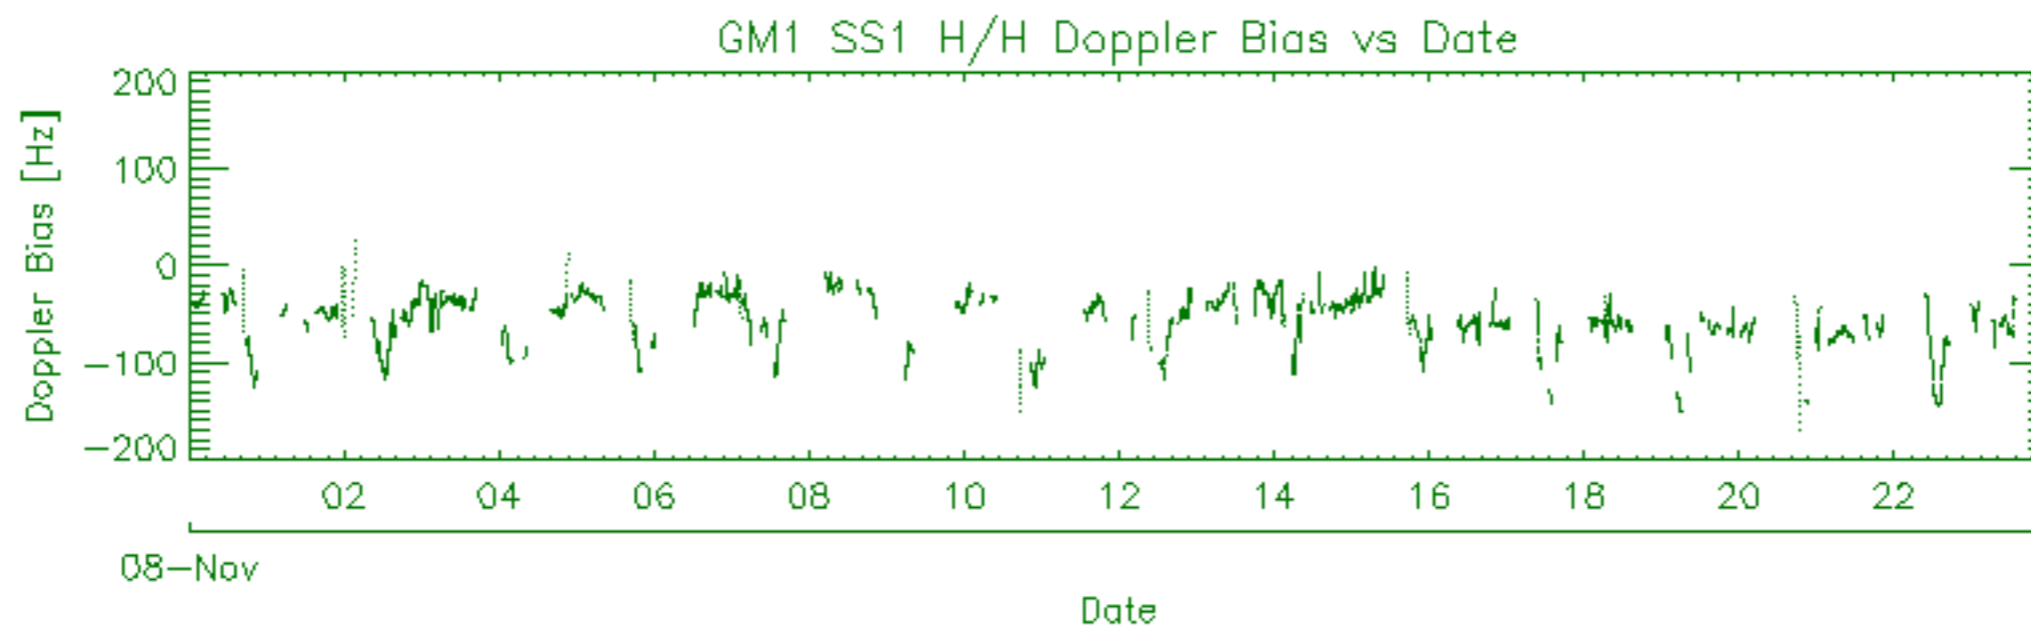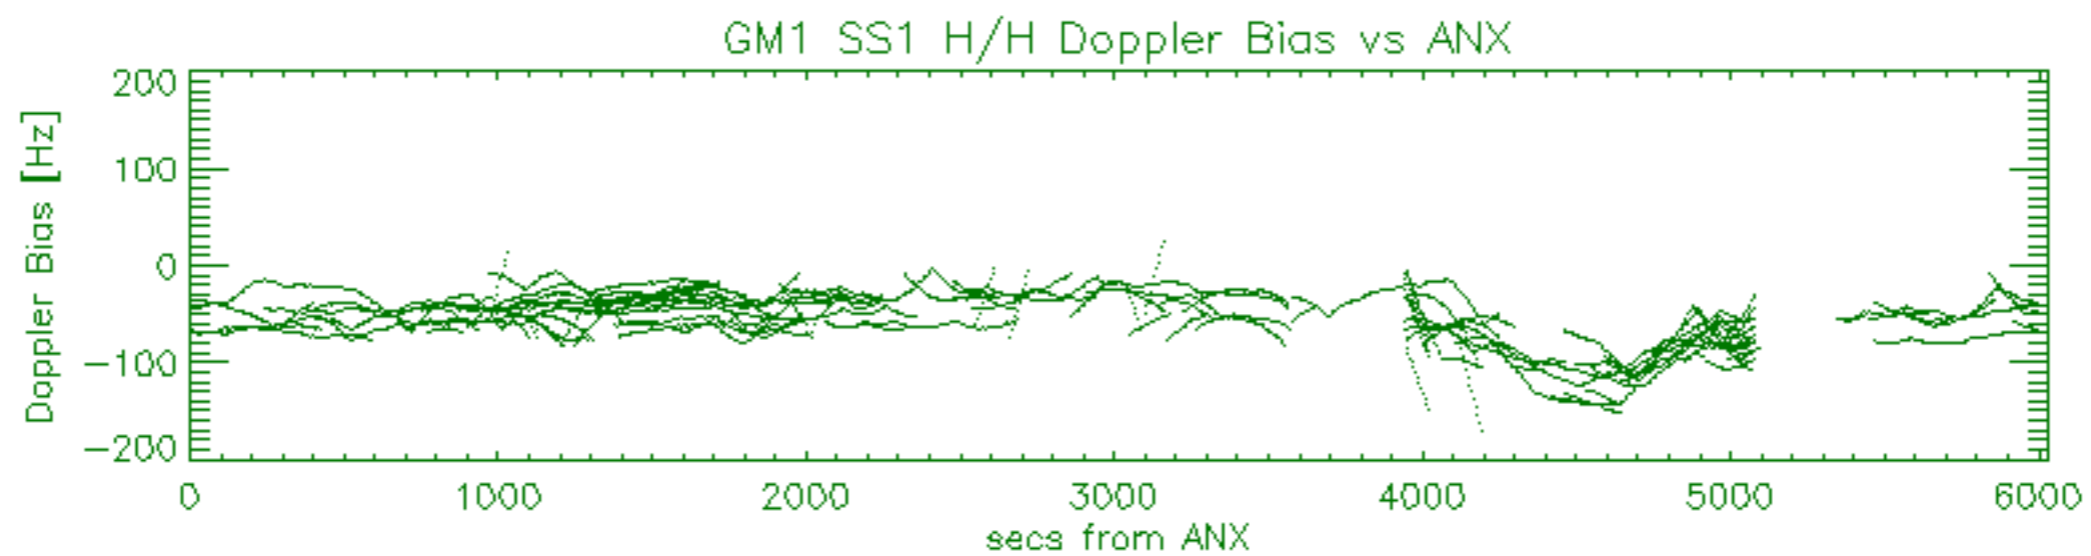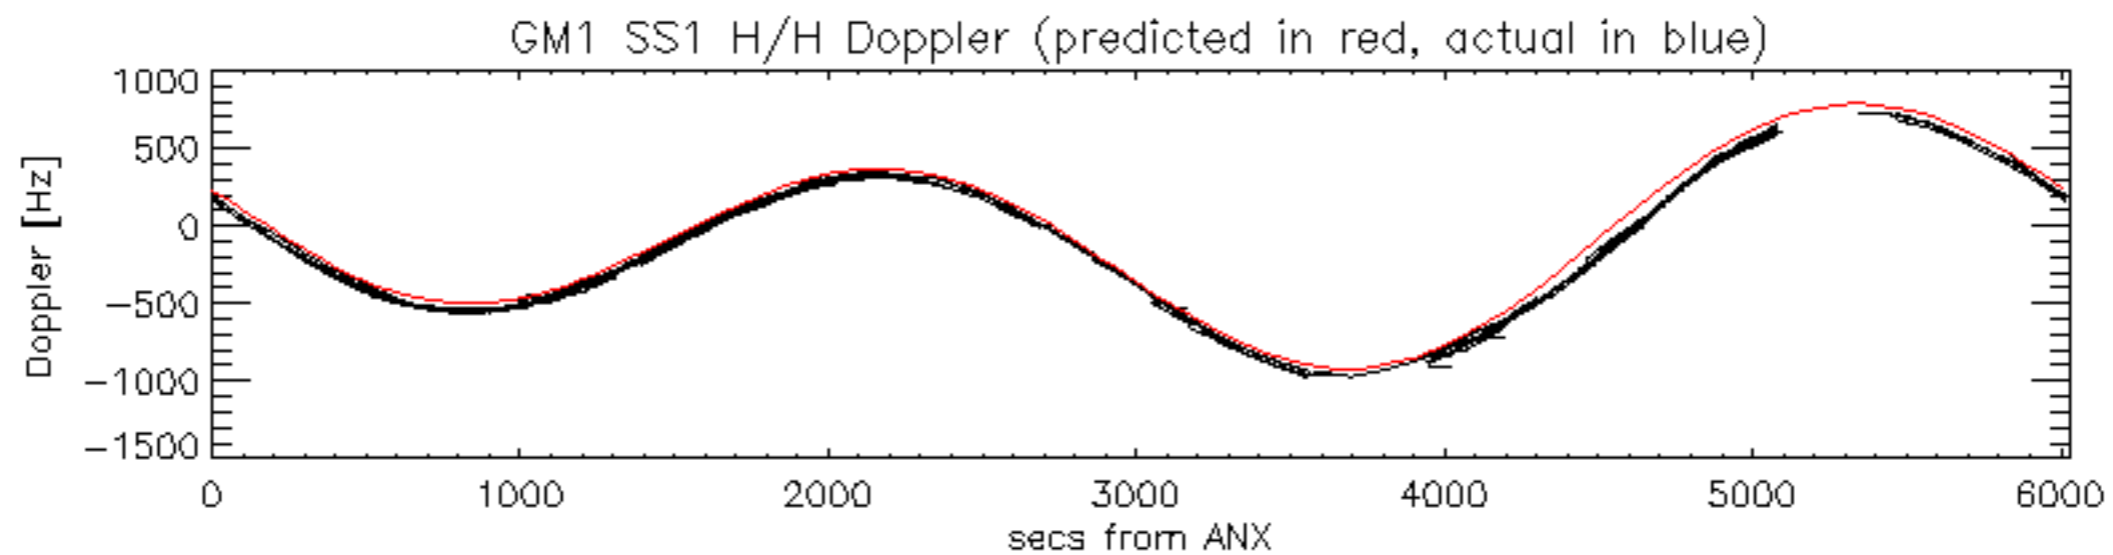


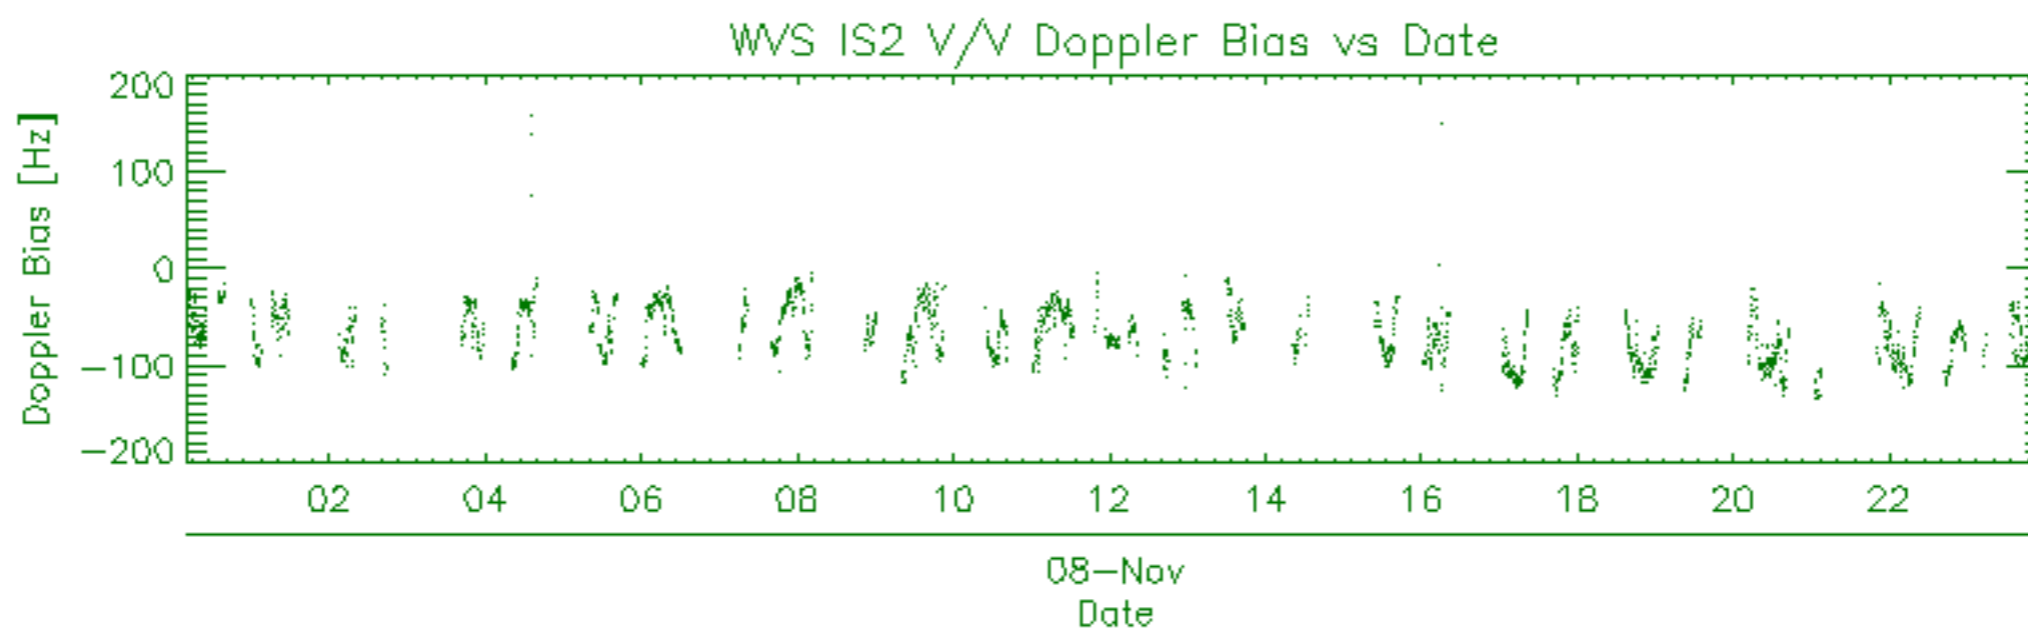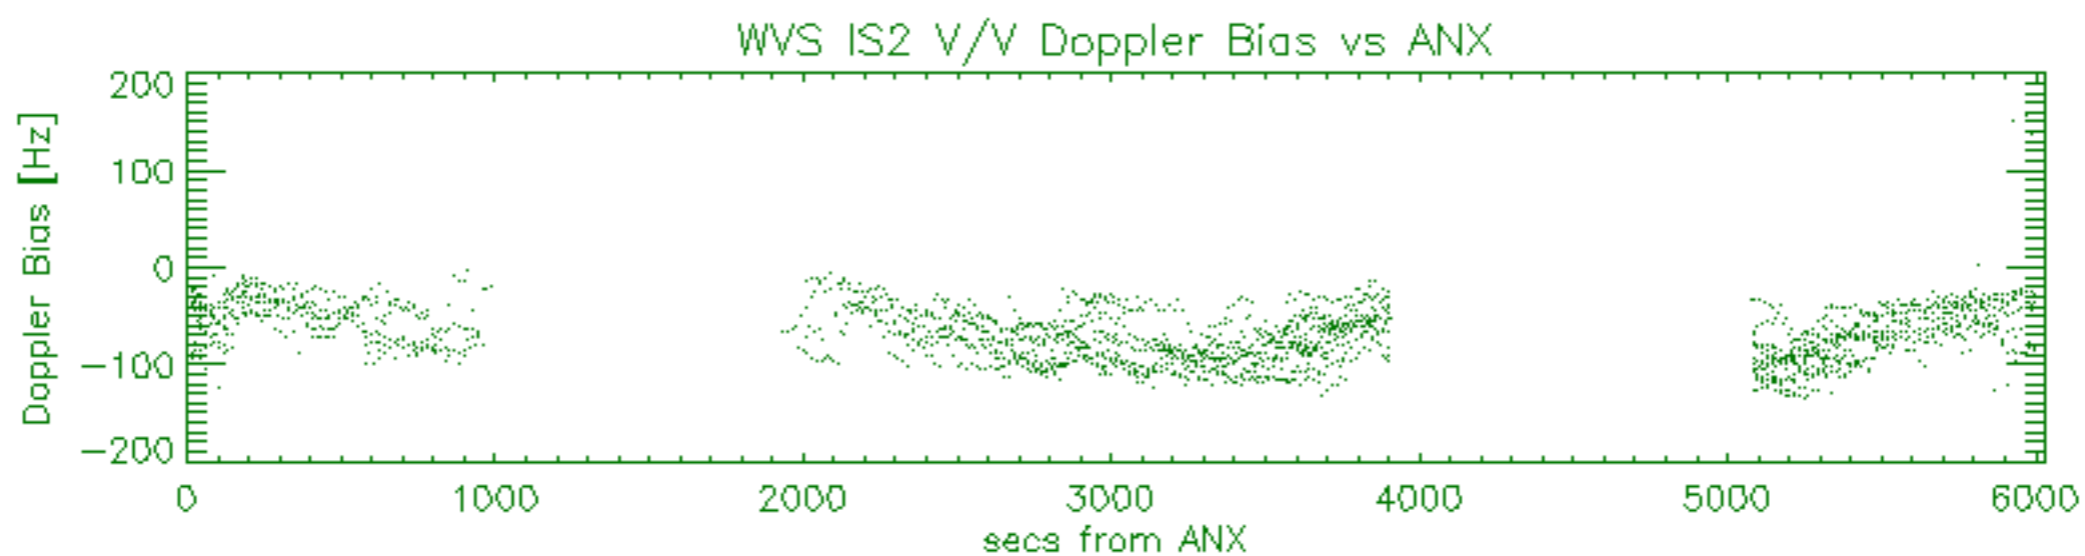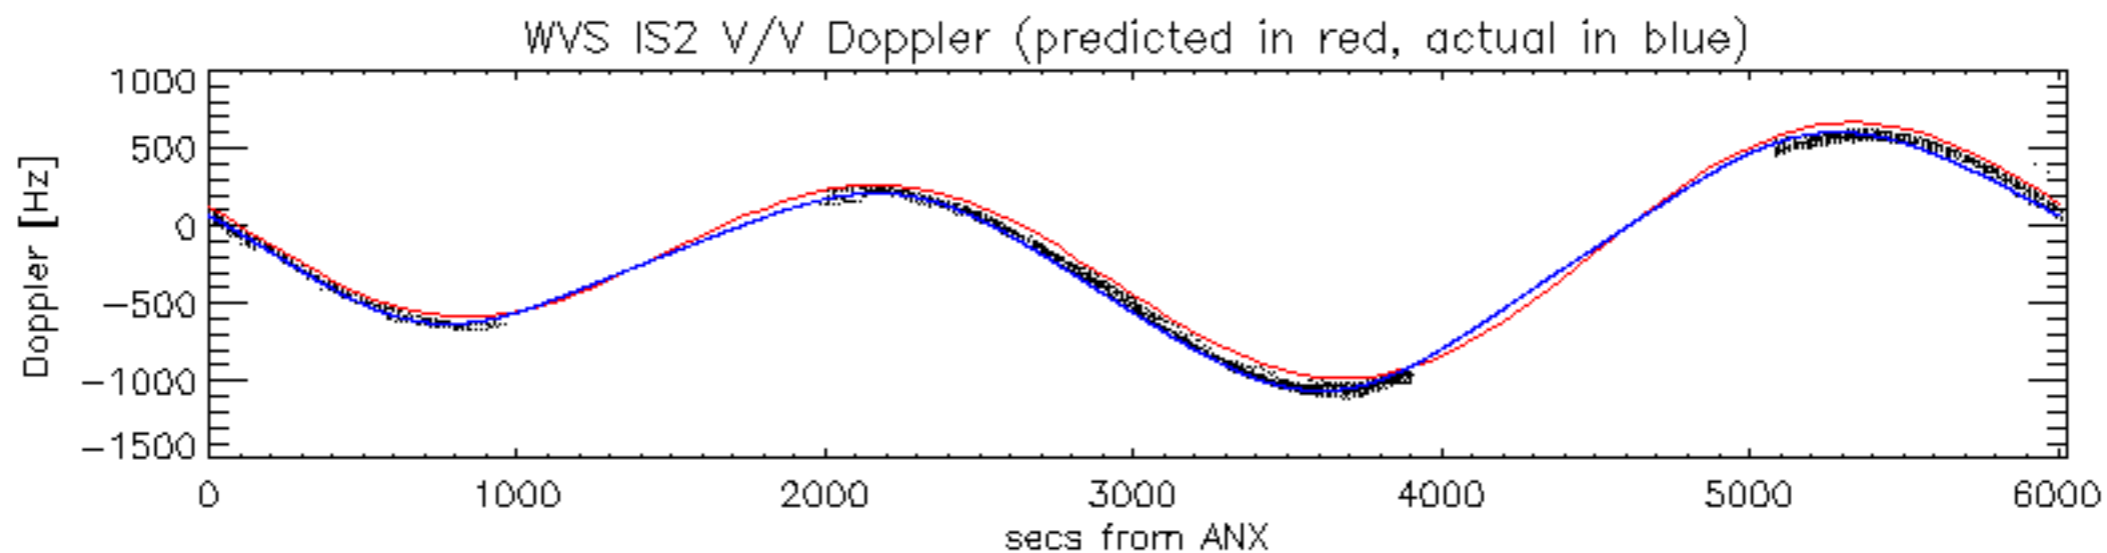








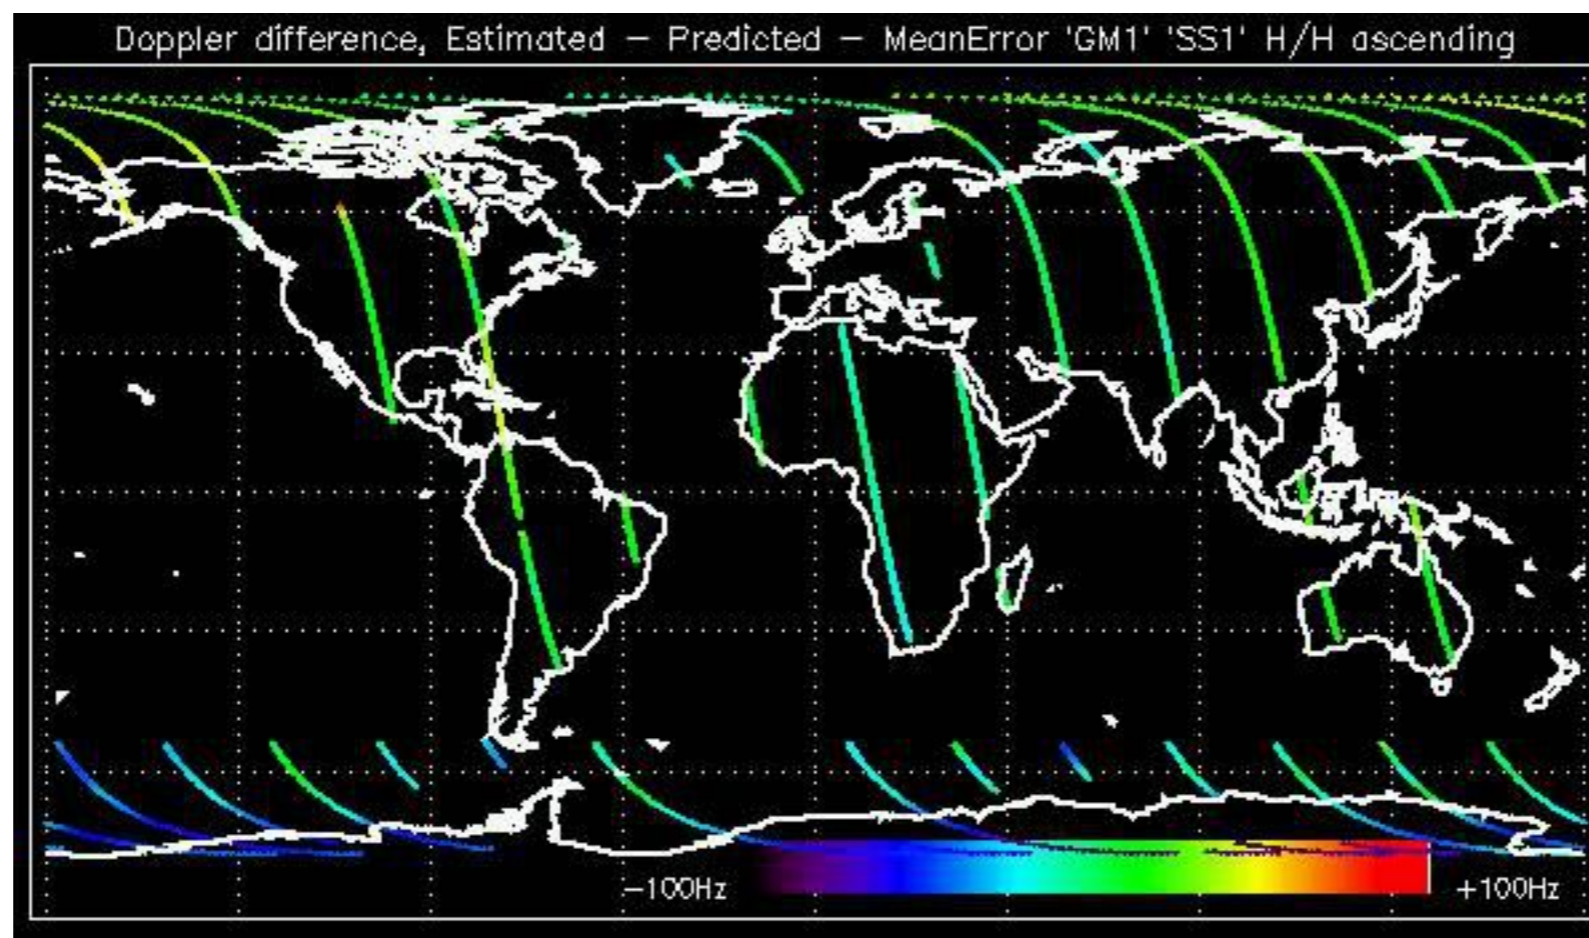


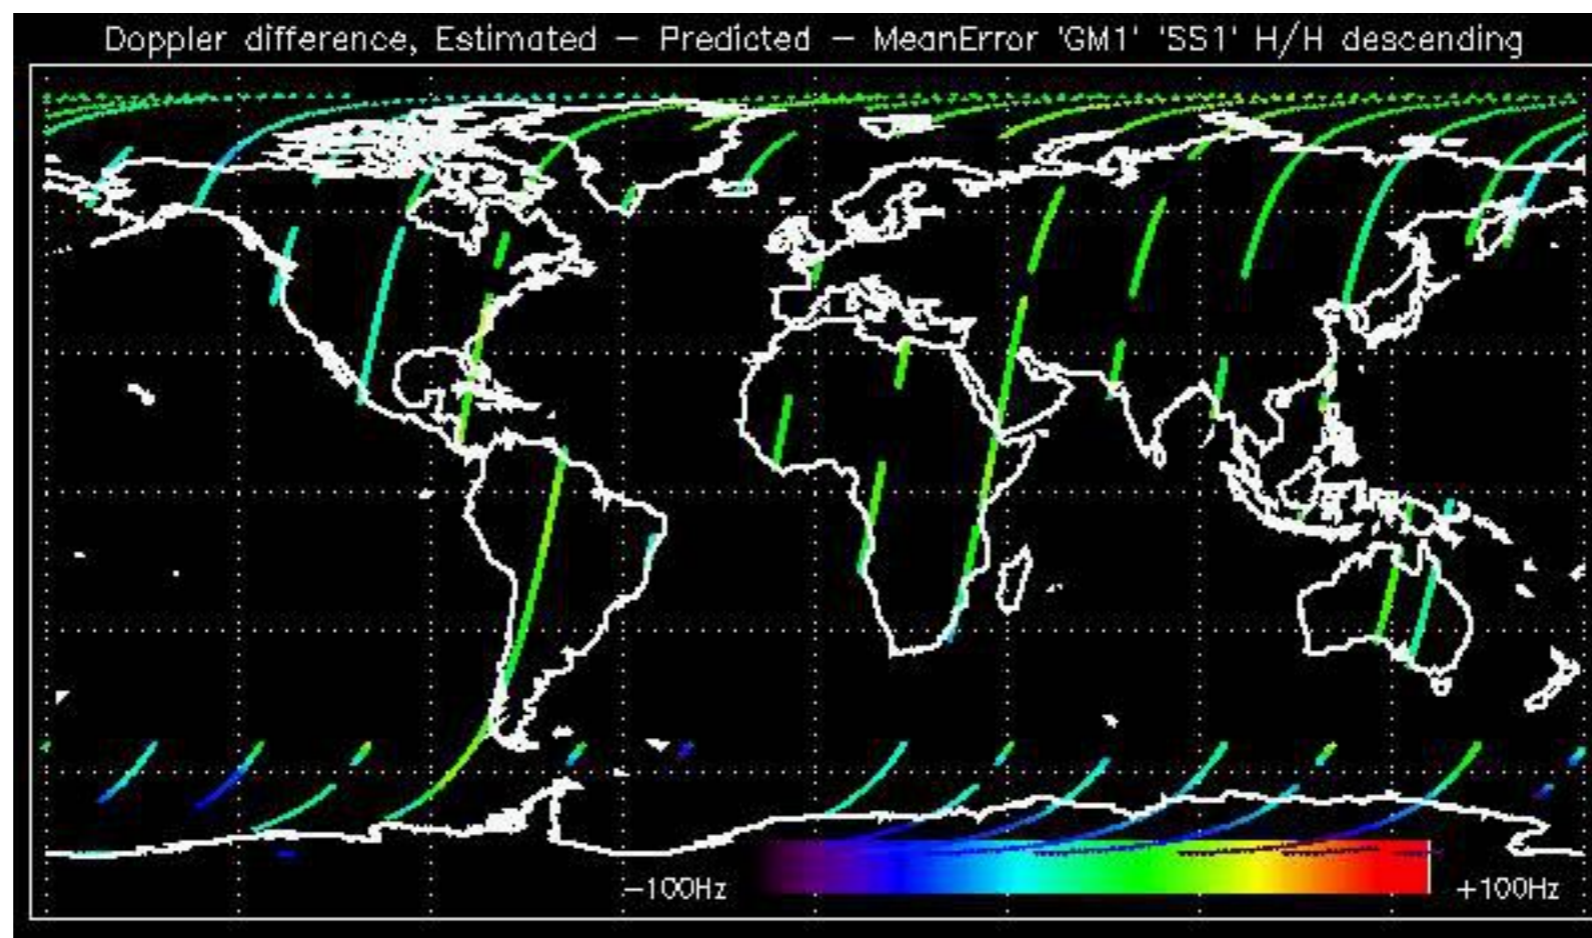

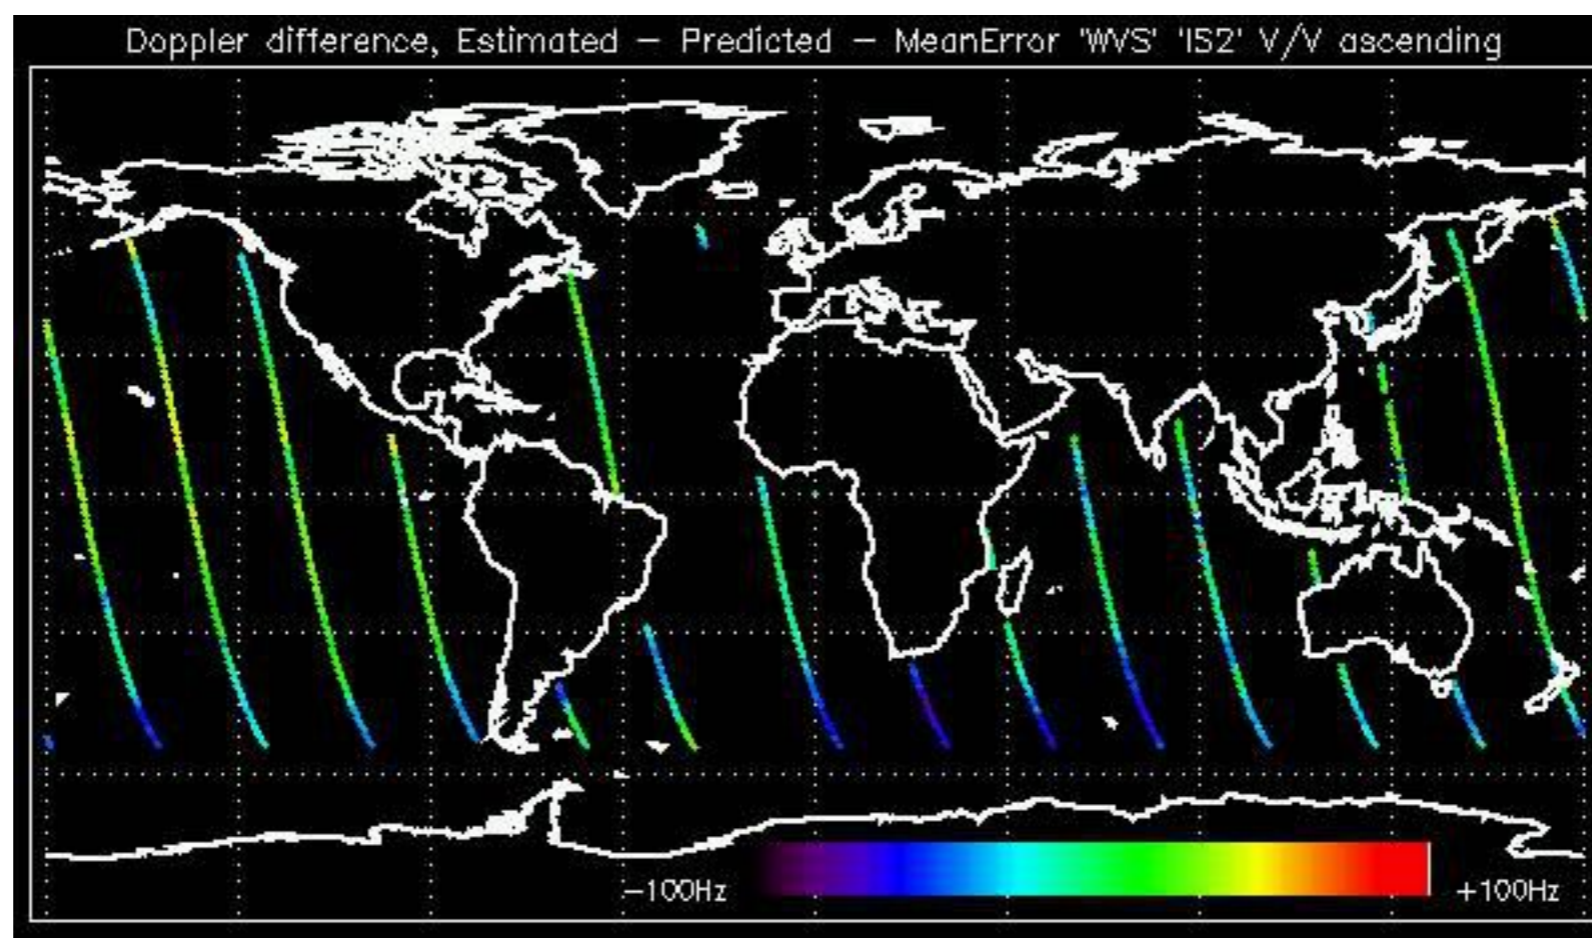

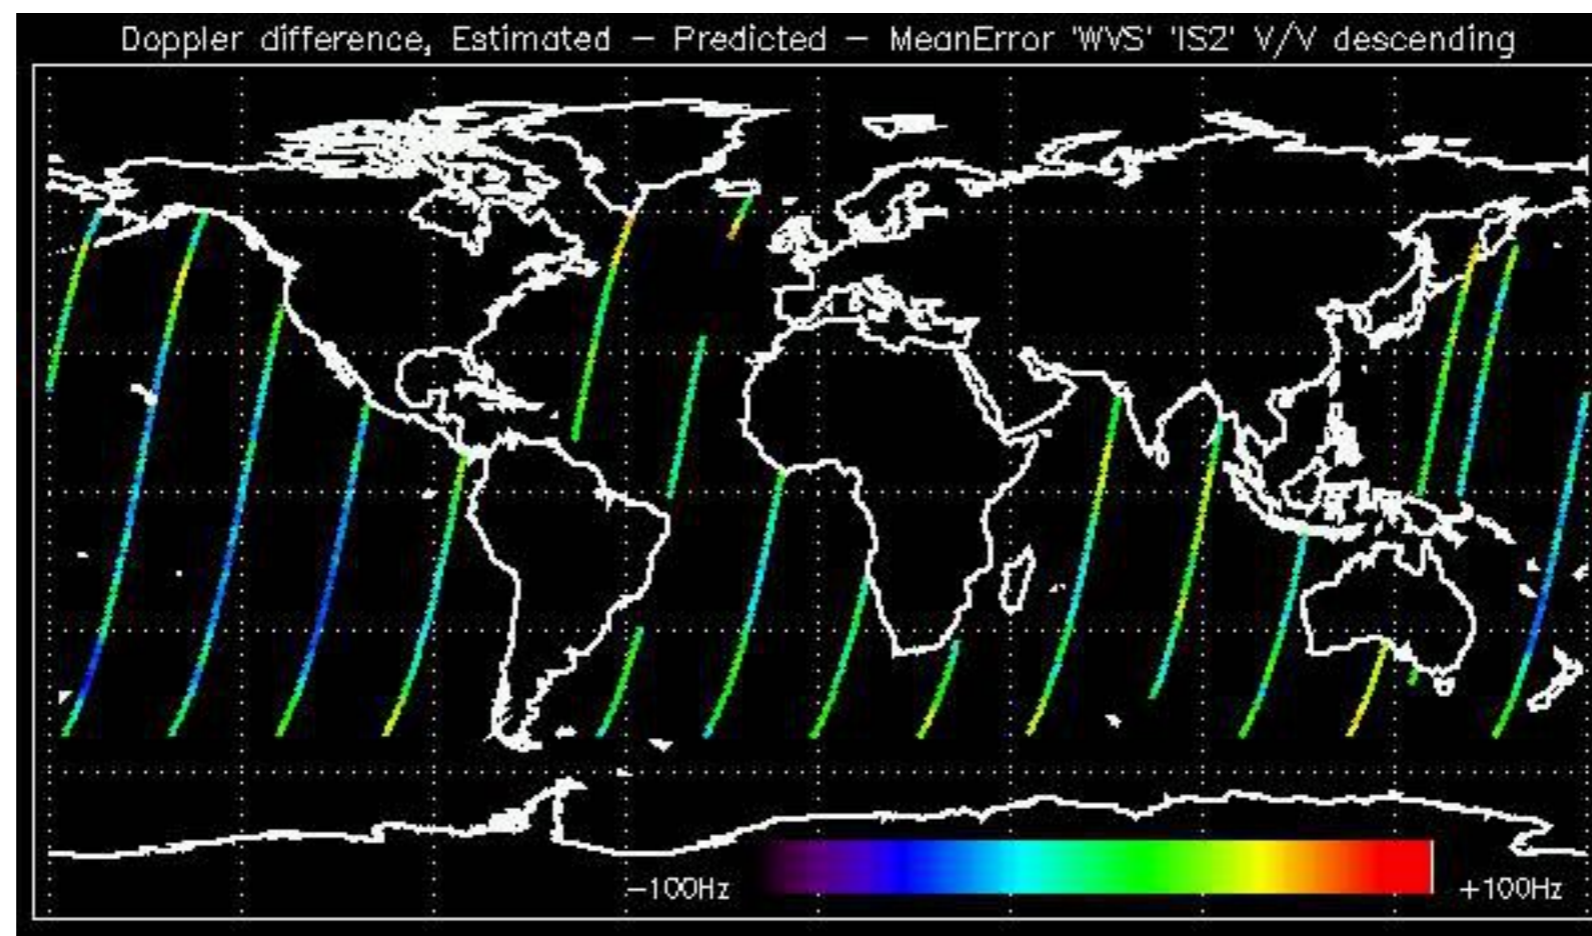

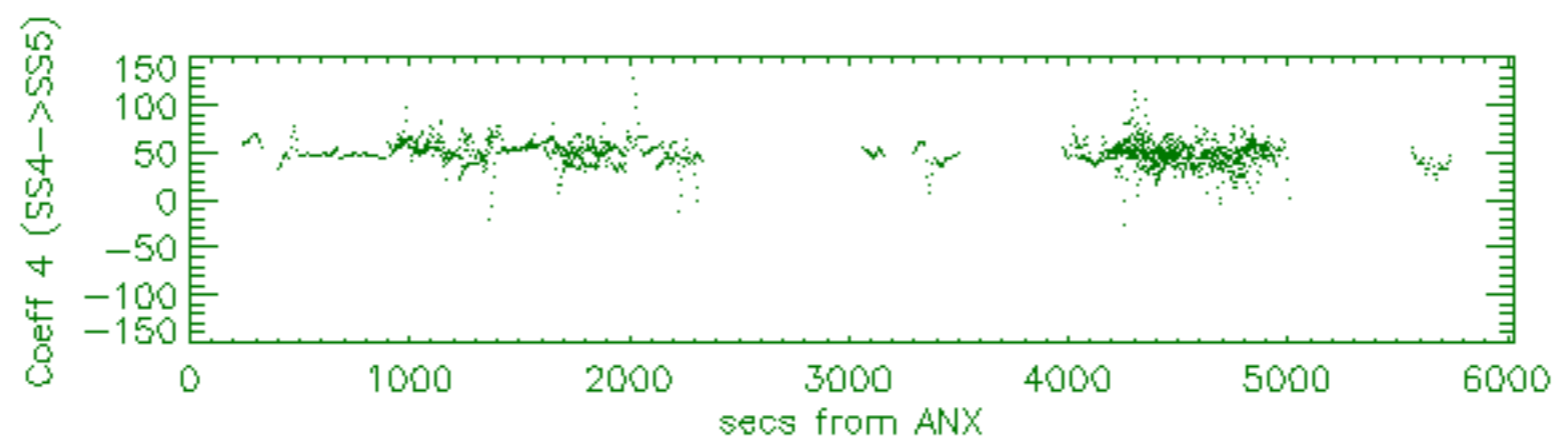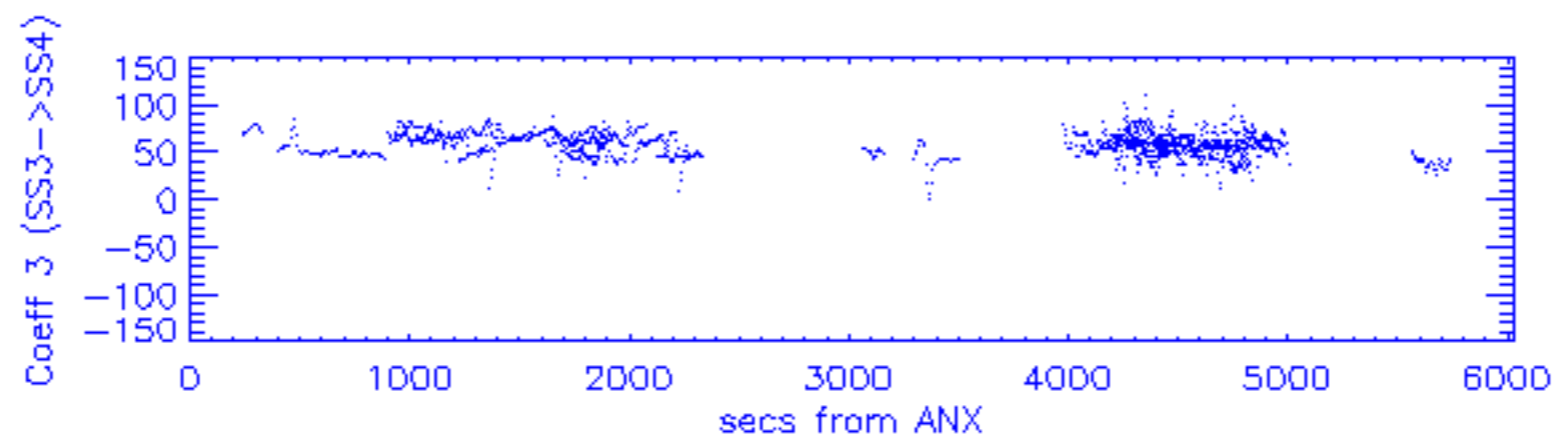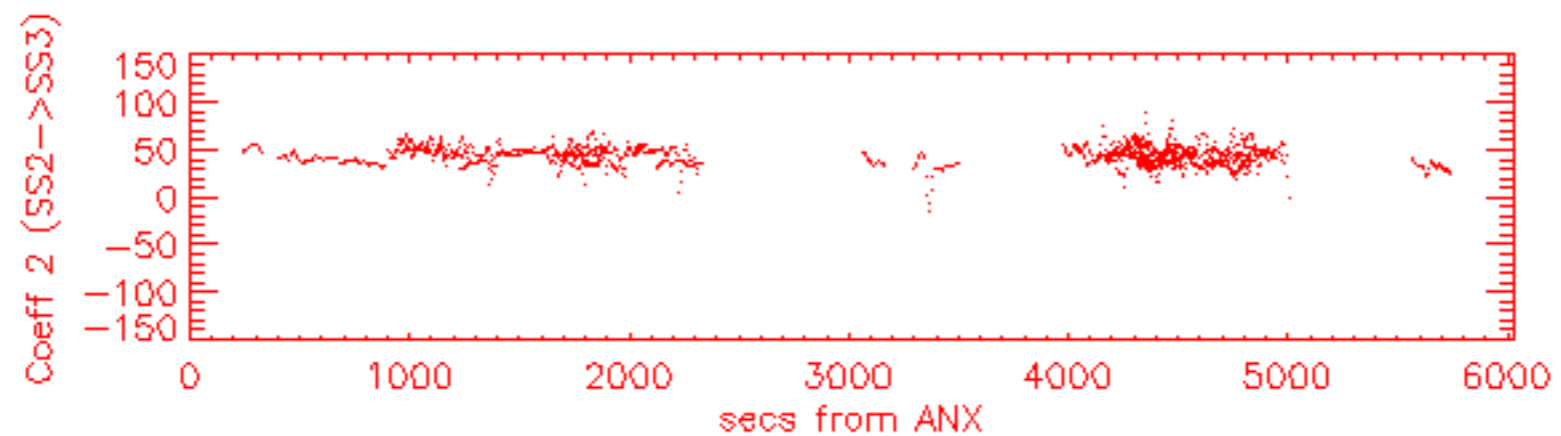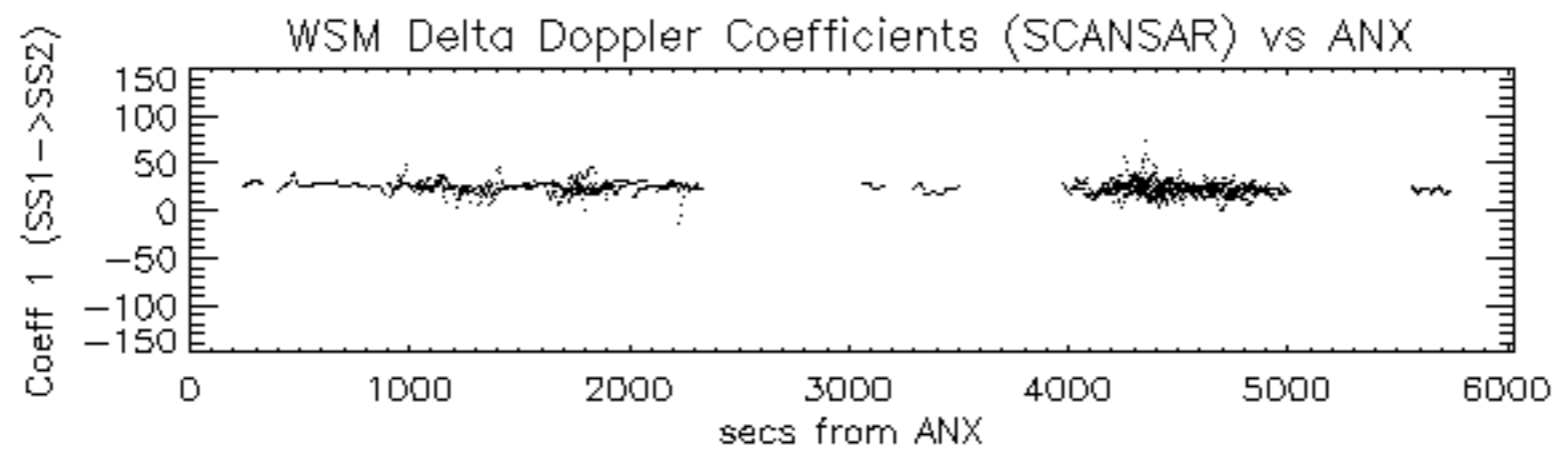

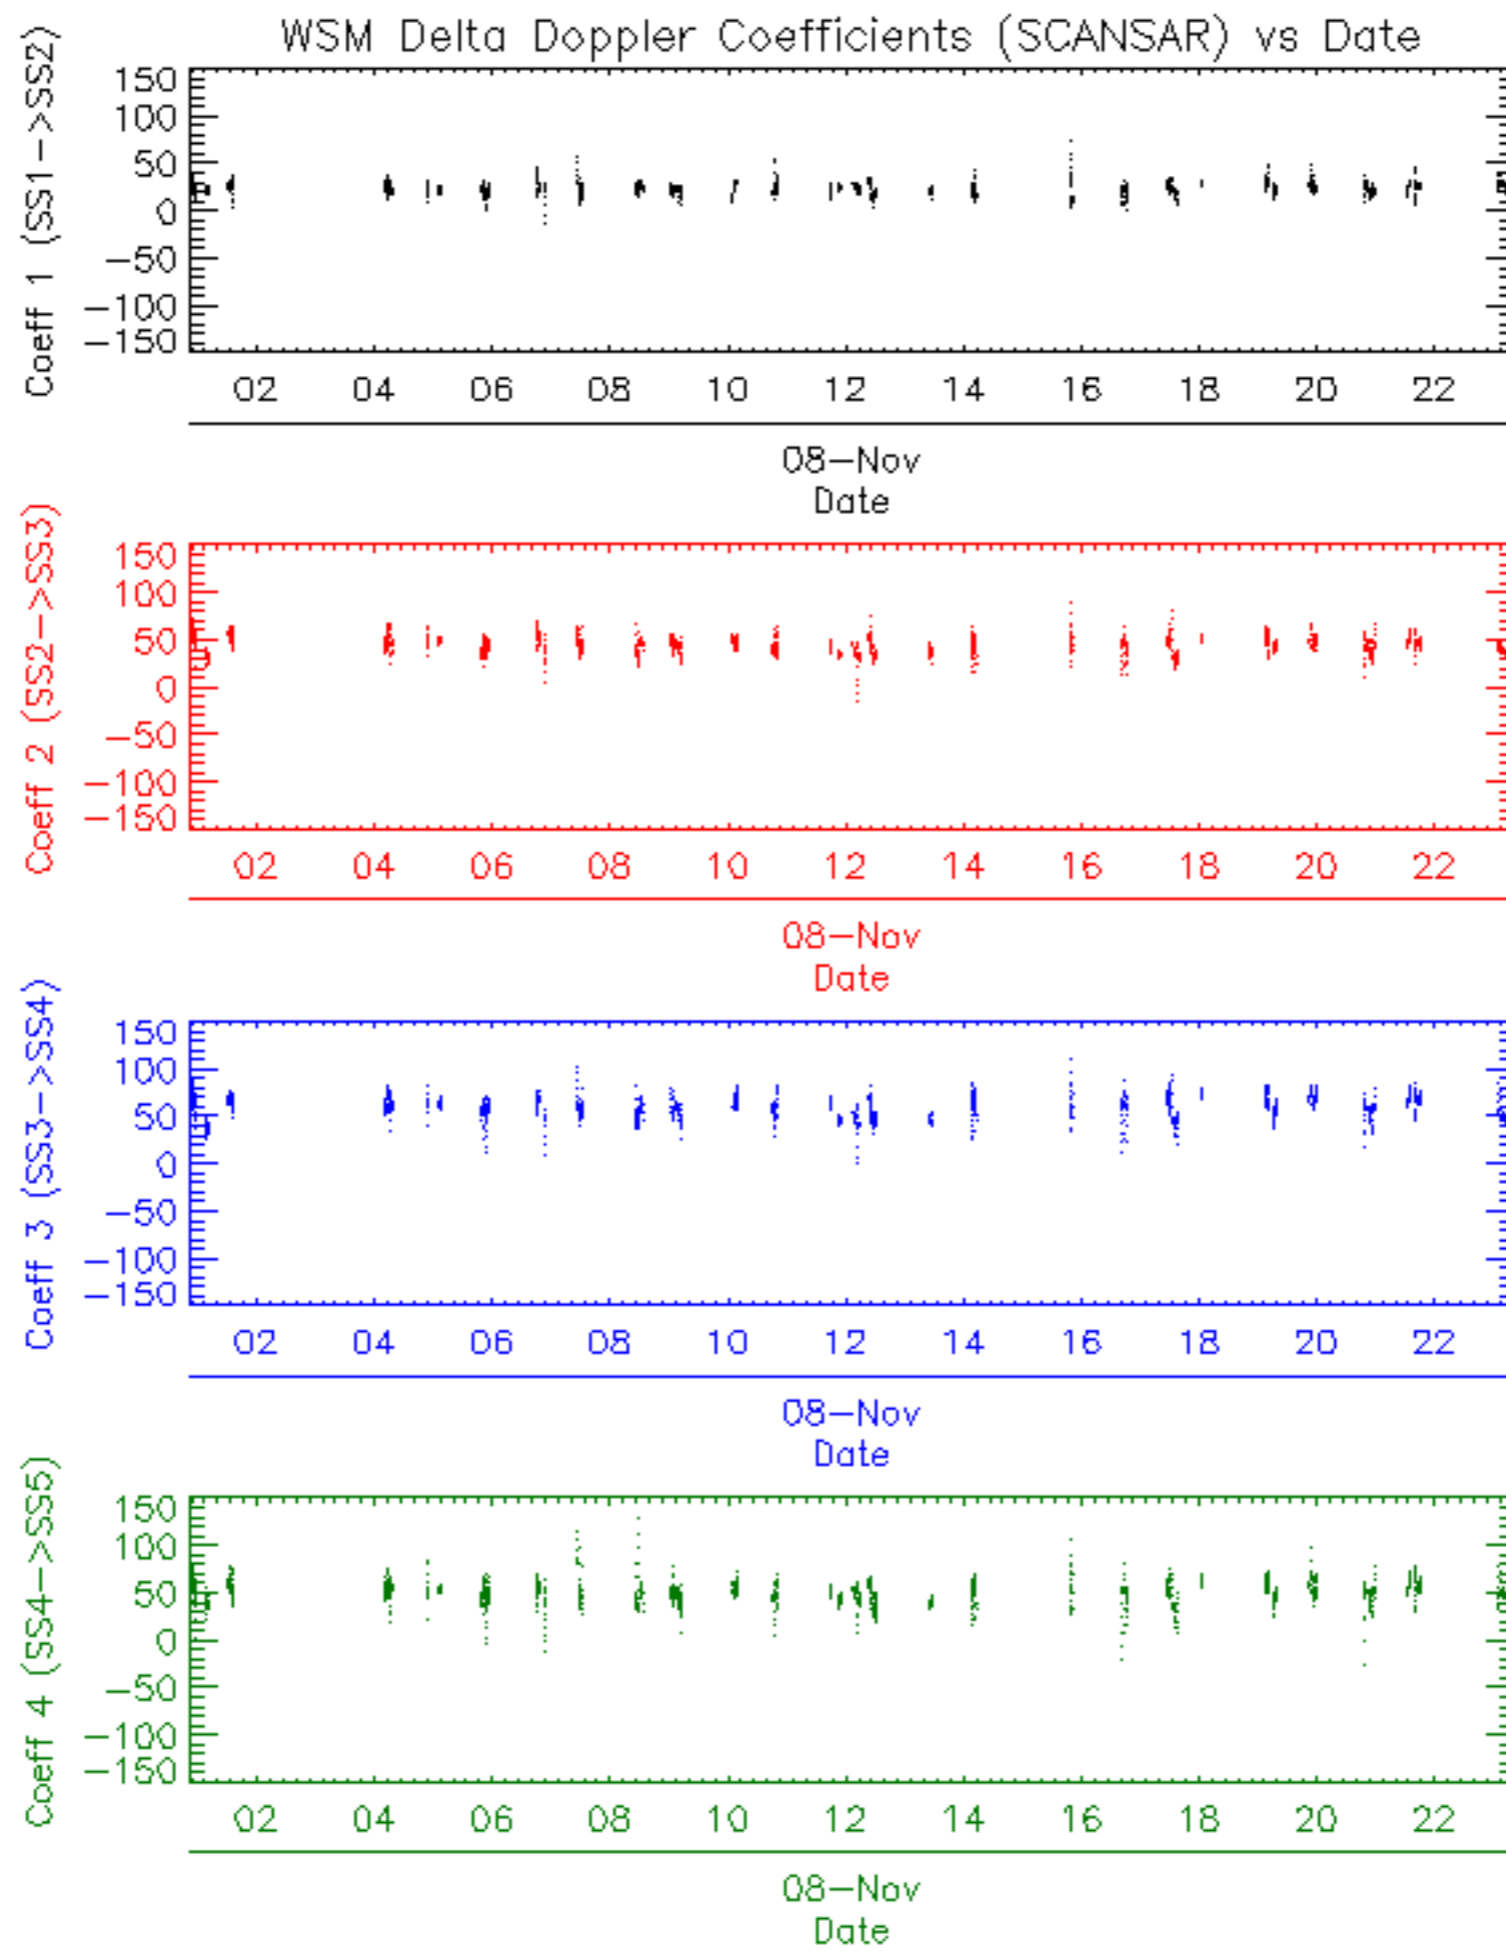






















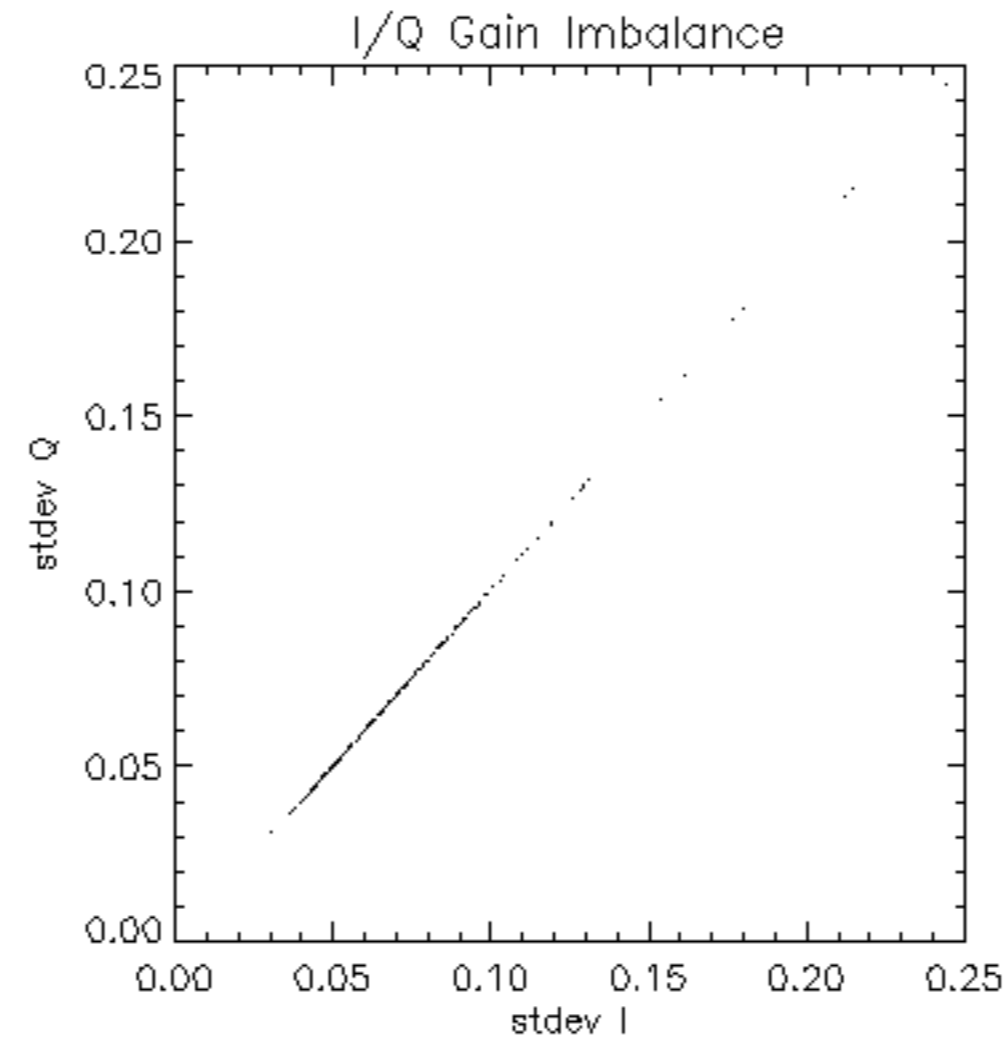


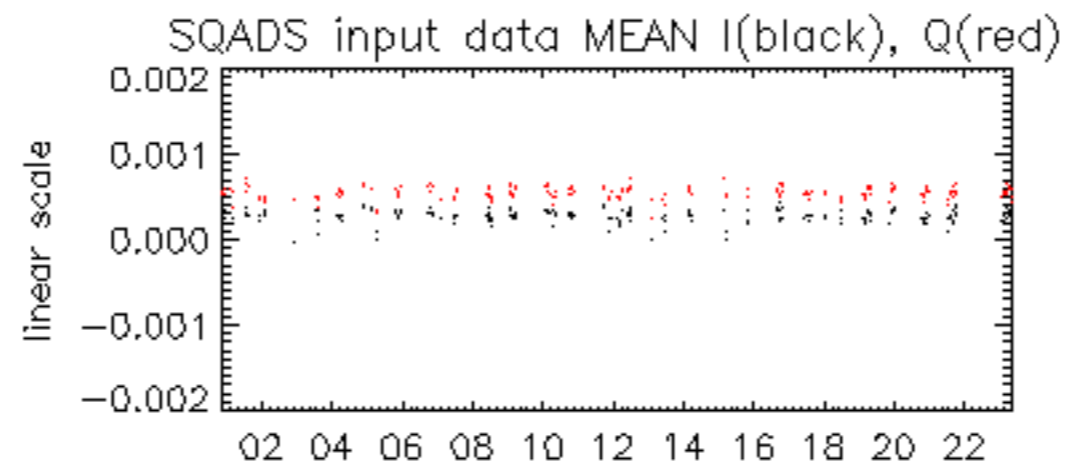

08-Nov

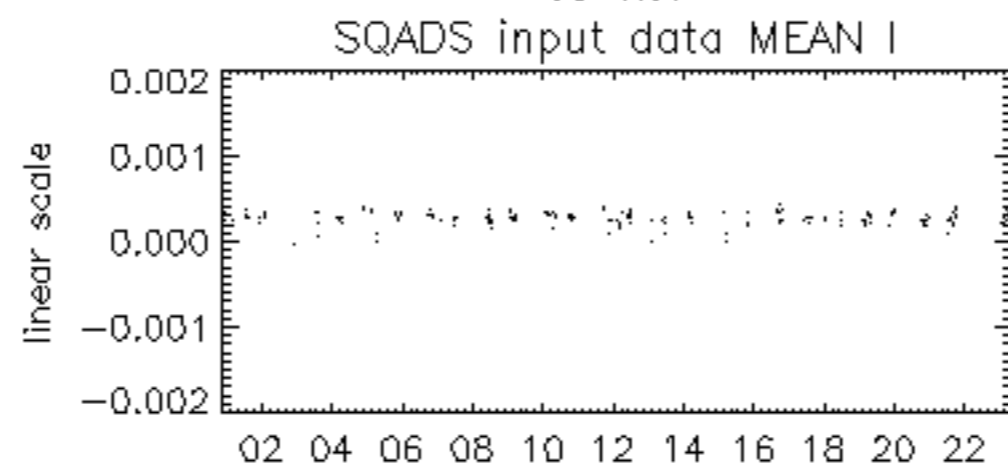


08-Nov

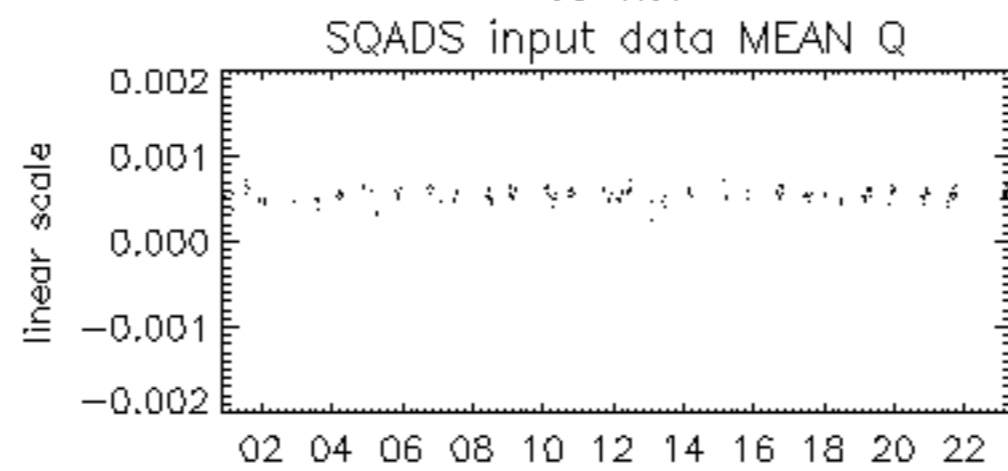


08-Nov




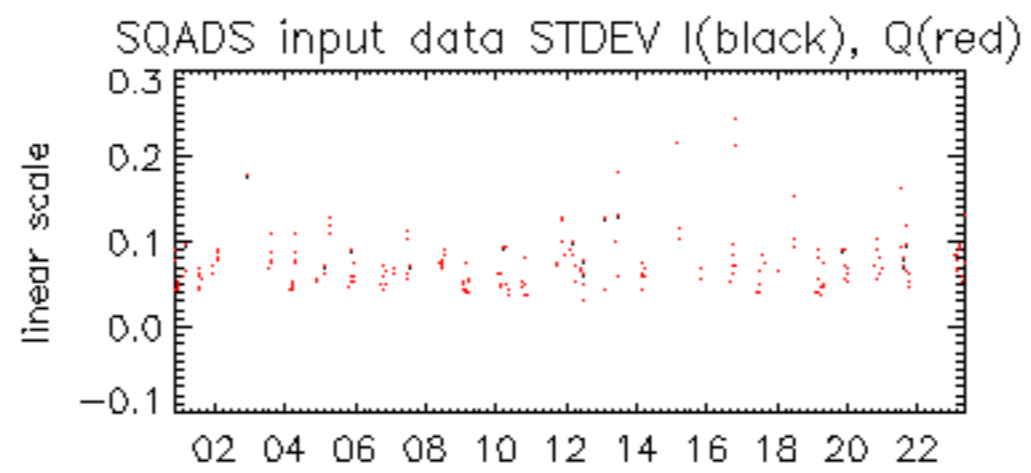


08-Nov

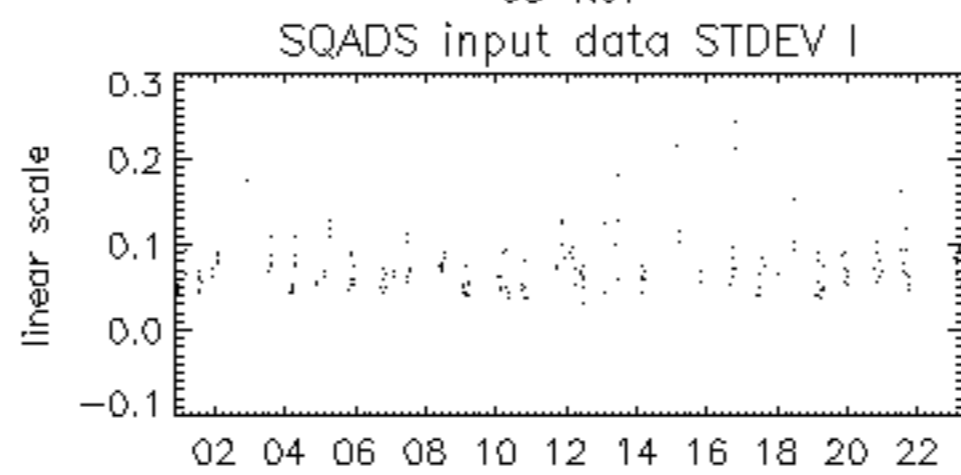



08-Nov

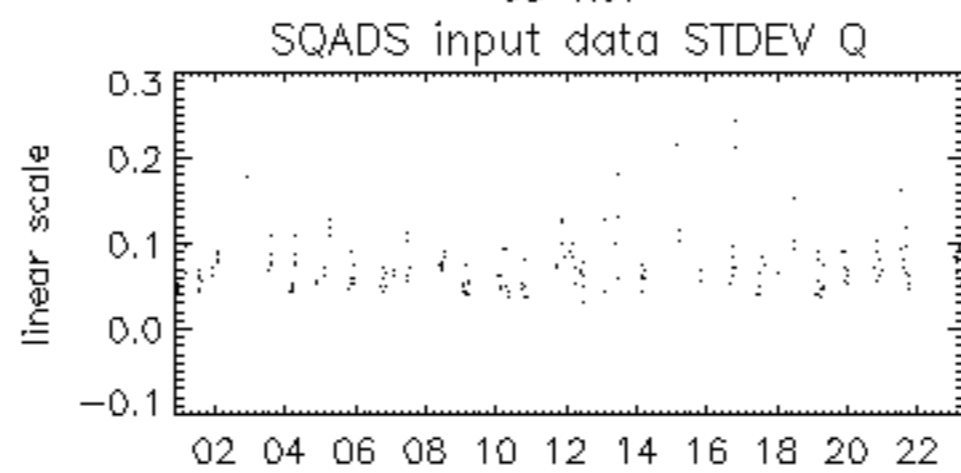


08-Nov

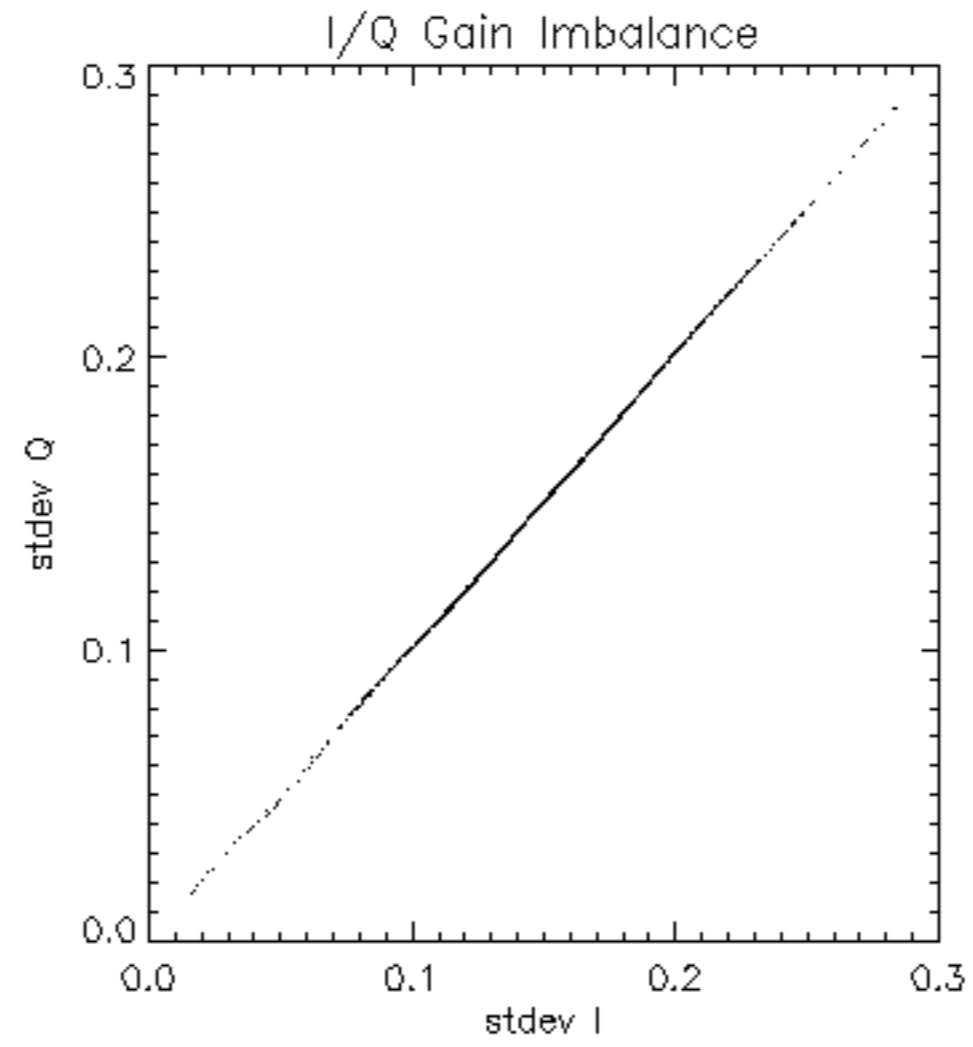

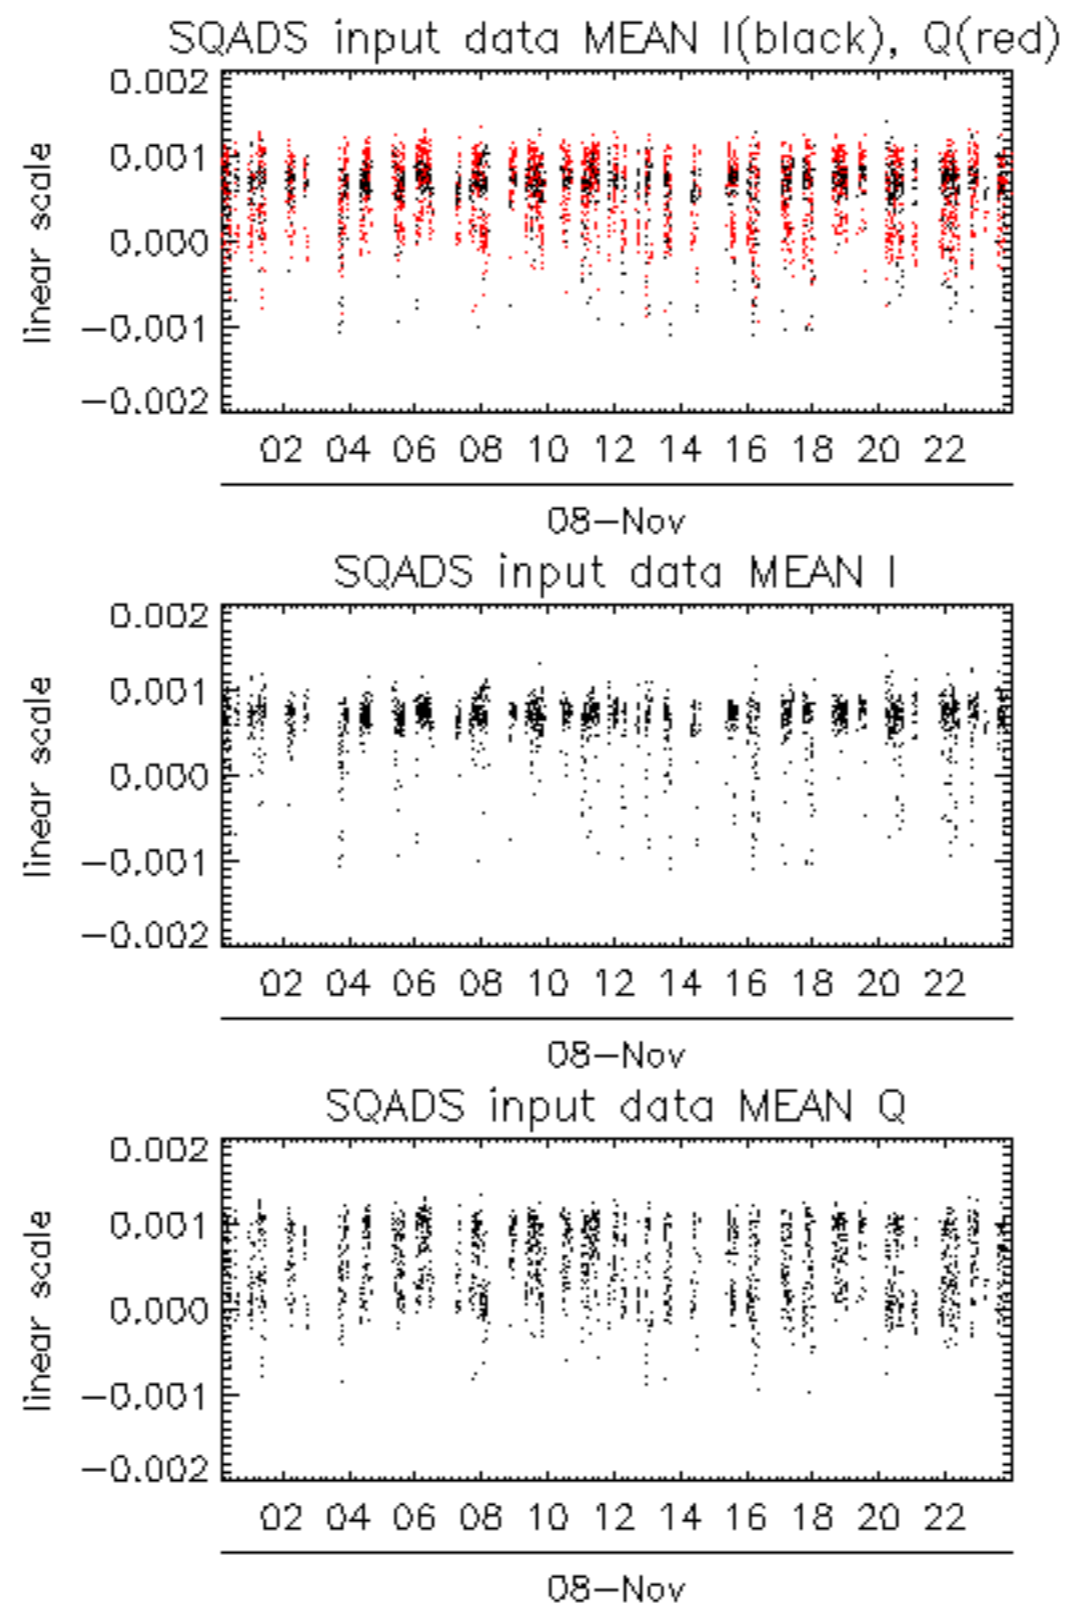


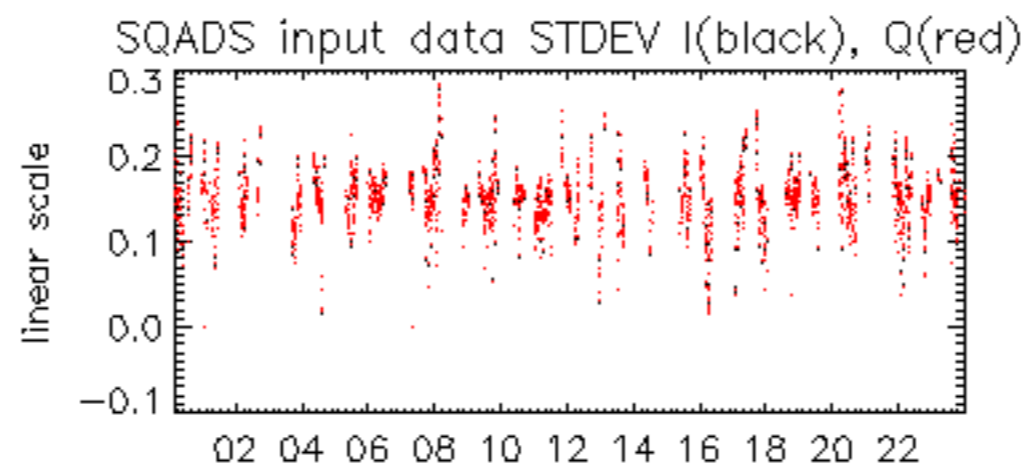

08-Nov

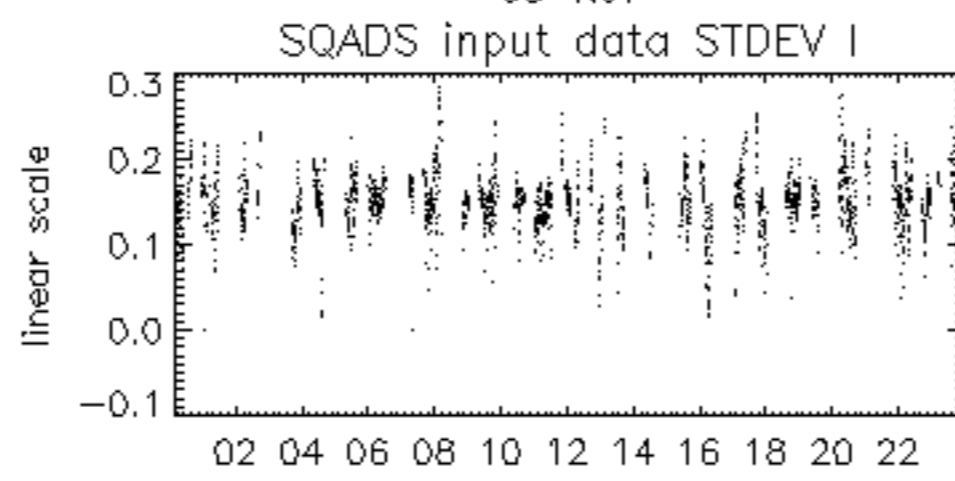

08-Nov

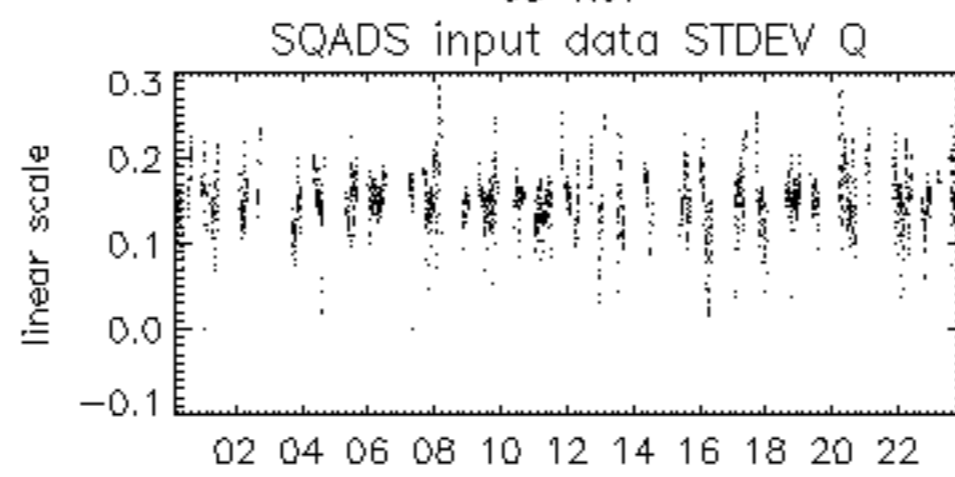

08-Nov





















