



Analysis from 22-OCT-2011 00:00:00 to 22-OCT-2011 23:59:59. Page generated on 24-OCT-2011 12:38:41.
View log file: ASAR_Daily_Report_20111024_1237.log. For any anomalies please contact emma.hatton@vegaspaces.com, kajal.haria@vegaspaces.com.

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

SUMMARY

1. DATA SUMMARY
 - 1.1 Summary tables
 - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
 - 2.1 IECF operational ADFs list
 - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
 - 3.1 V/V polarisation
 - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
 - 4.1 Analysis for WVS IS2 V/V
 - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
 - 4.1.2 All Rows Analysis for WVS IS2 V/V
 - 4.2 Analysis for GM1 SS3 H/H
 - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
 - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
 - 5.1 Analysis for WVS IS2 V/V
 - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
 - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
 - 5.2 Analysis for GM1 SS1 H/H
 - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
 - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
 - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
 - 6.1 Analysis for WSM SS1 H/H
 - 6.1.1 ScaleFactor
 - 6.2 Analysis for WSM SS1 V/V
 - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
 - 7.1 Analysis for WVS
 - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
 - 8.1 Number of Missing Lines
 - 8.2 Number of Gaps

1 - DATA SUMMARY

1.1 - Summary tables

[[BACK TO MENU](#)]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	4	PDE	WS	H/H	25	PDE	IS2	H/H	1	PDE	IS2	H/H	1	PDE	WS	H/H	27	PDE	2011-10-22 04:48:37	H	320
PDE	IS2	V/V	23	PDE	WS	H/H	4	PDE	IS4	H/H	2	PDE	IS2	V/V	1	PDE	WS	V/V	6	PDE	2011-10-22 23:11:10	H	320
PDE	IS2	V/V	3	PDK	WS	H/H	53	PDE	IS4	V/H	2	PDE	IS6	H/H	6	PDE	WS	H/H	3	PDK	2011-10-22 06:28:51	V	320
PDK	IS2	V/V	24					PDE	IS7	H/H	1					PDK	WS	H/H	11				
																PDK	WS	V/V	5				
																PDK	WS	H/H	1				

1.2 - Lists of products used

[[BACK TO MENU](#)]

[\[TXT\]](#) [\[XLS\]](#) List_WVS_products_used
[\[TXT\]](#) [\[XLS\]](#) List_GM1_products_used
[\[TXT\]](#) [\[XLS\]](#) List_APM_products_used
[\[TXT\]](#) [\[XLS\]](#) List_IMM_products_used
[\[TXT\]](#) [\[XLS\]](#) List_WSM_products_used
[\[TXT\]](#) [\[XLS\]](#) List_MS_products_used

2 - AUXILIARY FILES ANALYSIS

2.1 - IECF operational ADFs list

[[BACK TO MENU](#)]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20110526_075001_20101027_215740_20141231_000000
ASA_INS_AXVIEC20110124_114858_20101228_112000_20141231_235959
ASA_XCH_AXVIEC20101222_143057_20020301_000000_20141231_000000
ASA_XCA_AXVIEC20110526_075734_20101027_215740_20141231_000000

2.2 - Products with wrong ADFs





[[BACK TO MENU](#)]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0

[\[TXT\]](#) [\[XLS\]](#) Check_ADFs_WVS
[\[TXT\]](#) [\[XLS\]](#) Check_ADFs_GM1
[\[TXT\]](#) [\[XLS\]](#) Check_ADFs_APM
[\[TXT\]](#) [\[XLS\]](#) Check_ADFs_IMM
[\[TXT\]](#) [\[XLS\]](#) Check_ADFs_WSM

3 - MODULE STEPPING PRODUCTS ANALYSIS








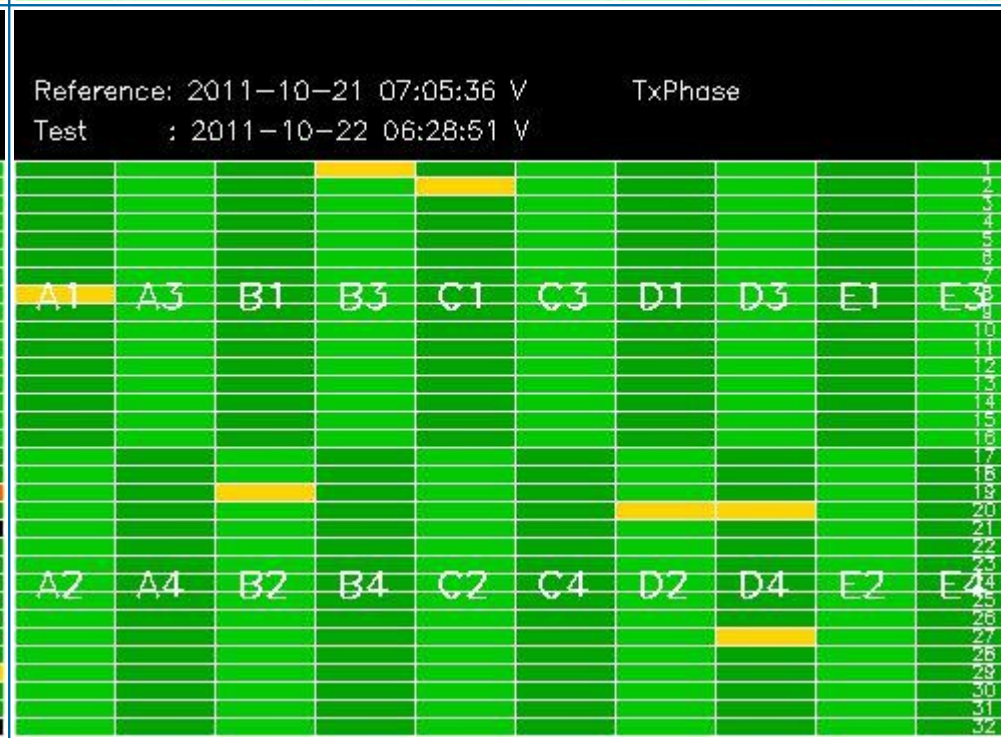
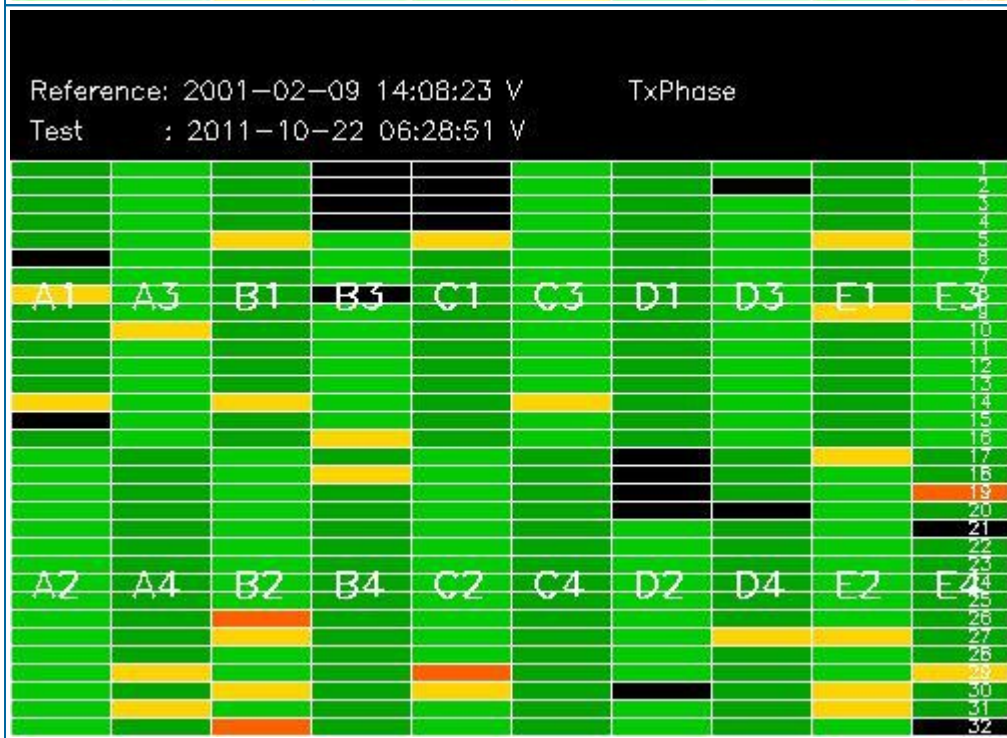
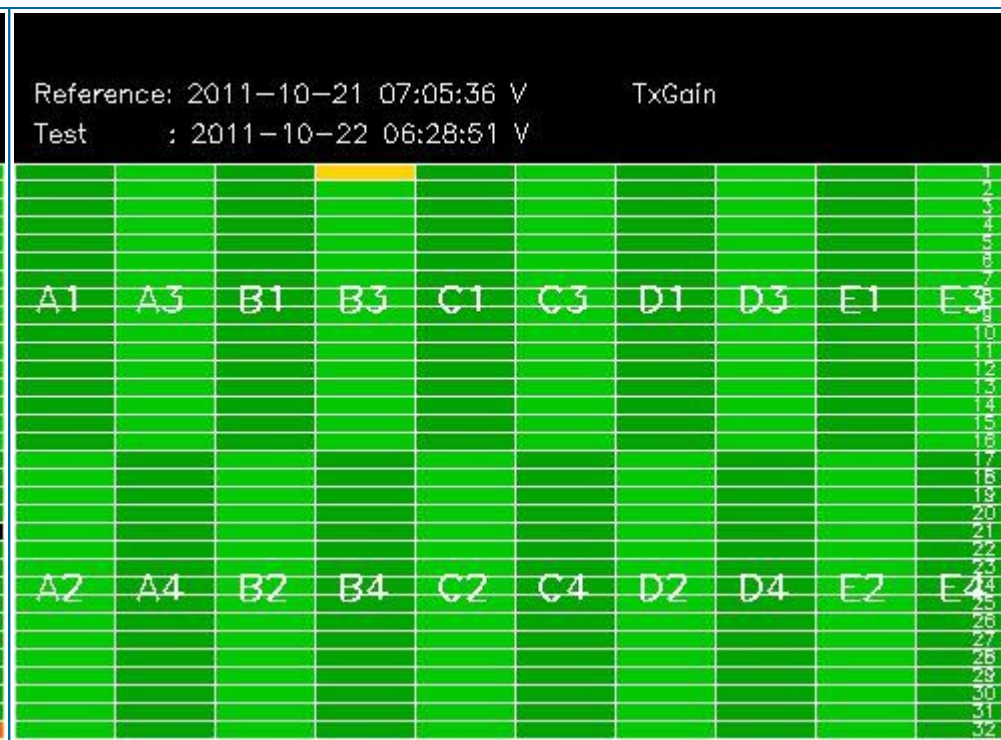
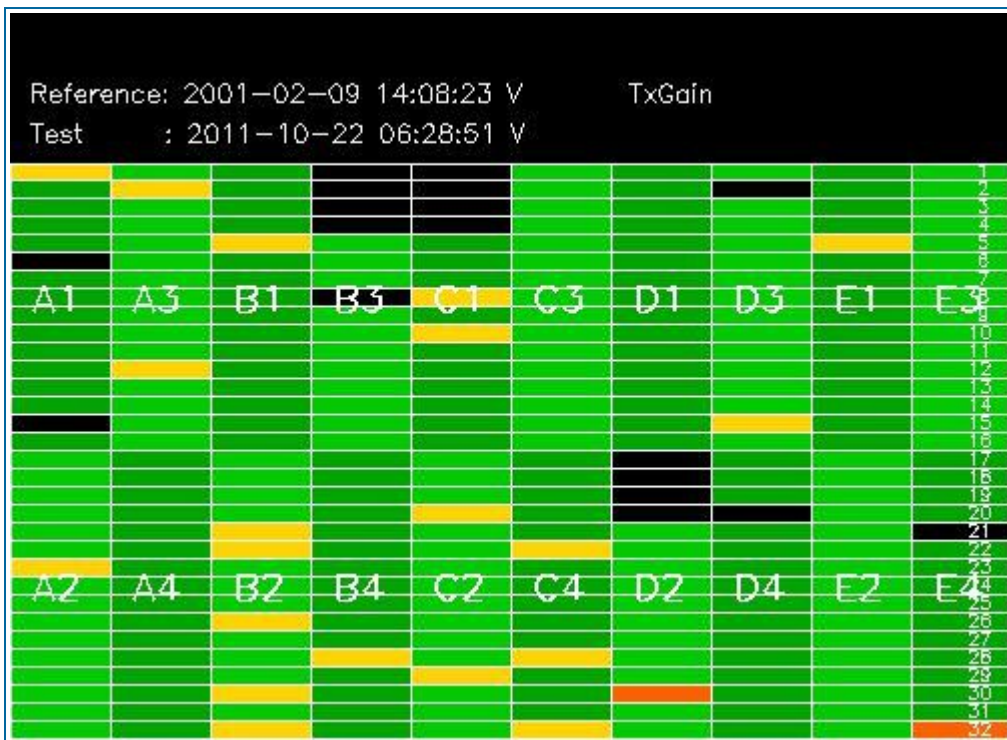


3.2 - H/H polarisation

[[BACK TO MENU](#)]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
Pre-launch reference (2001-02-09)	Previous product in the same polarisation

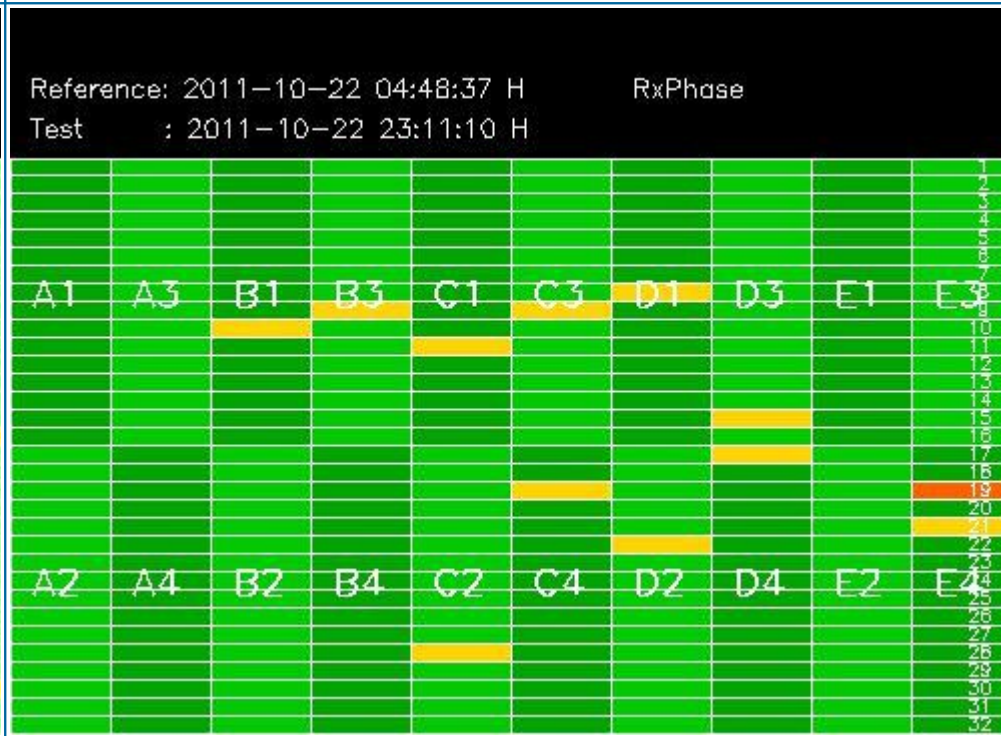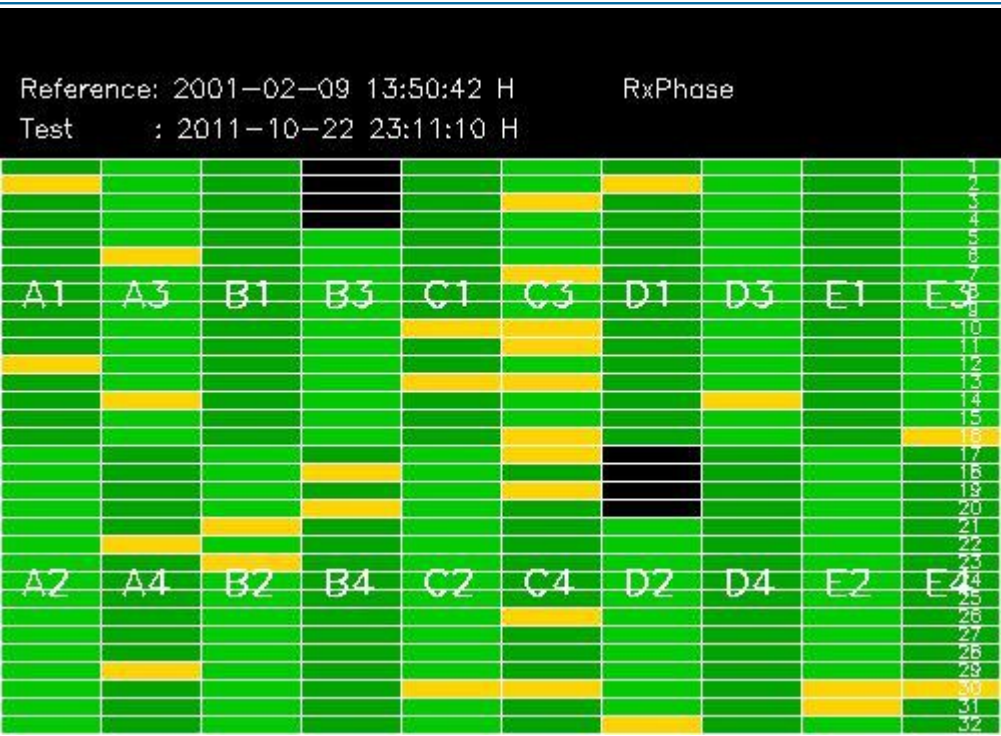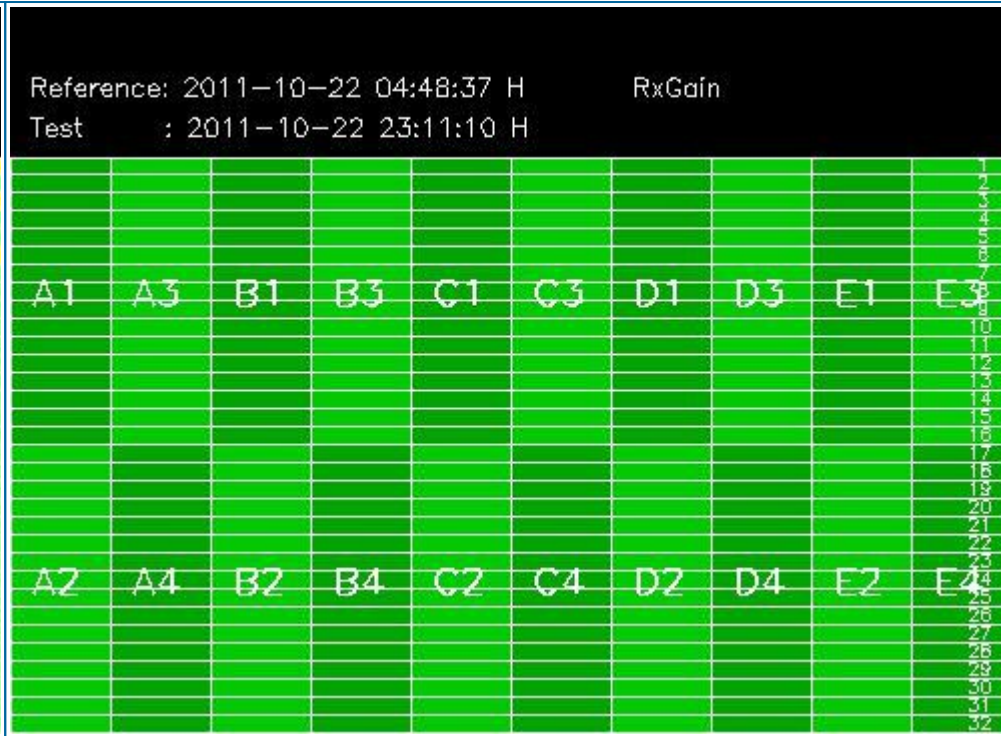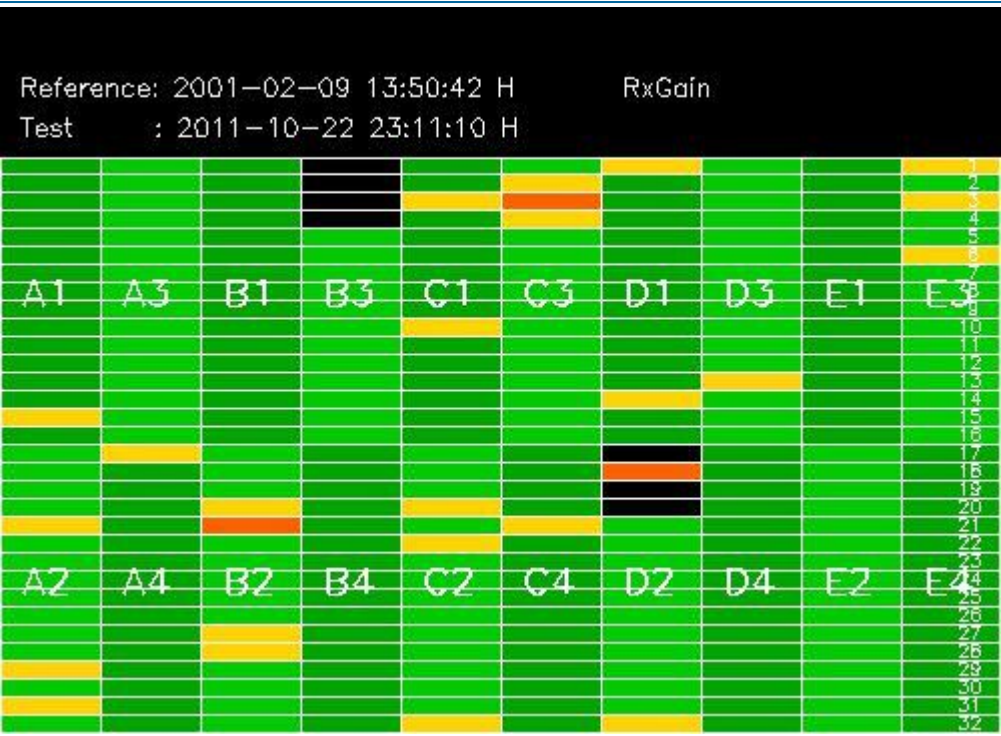

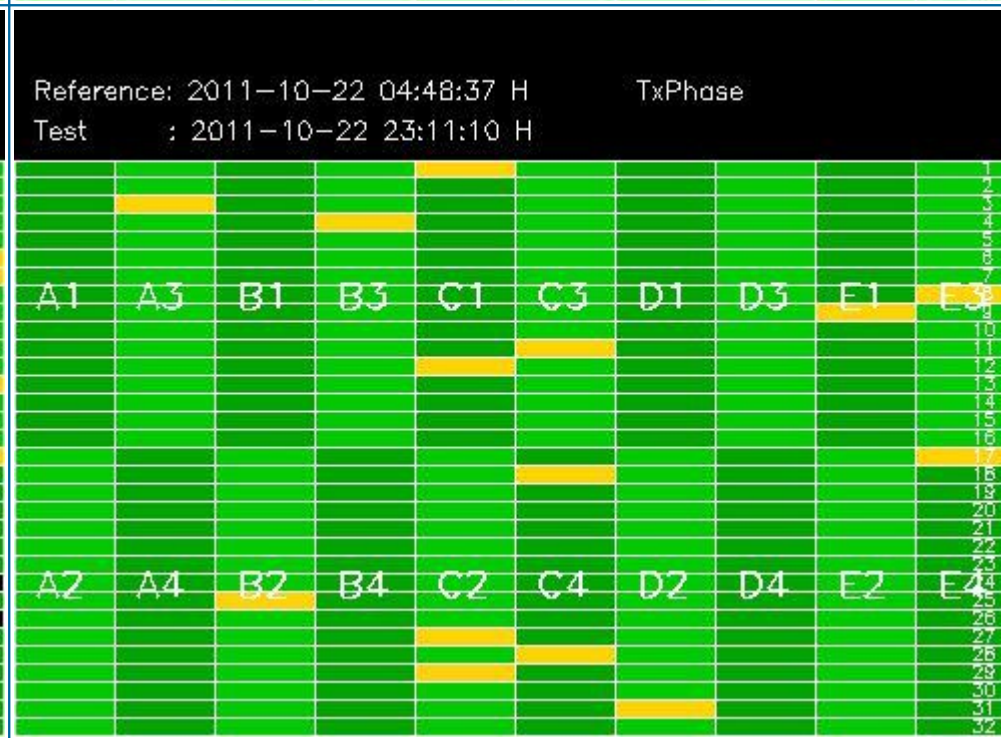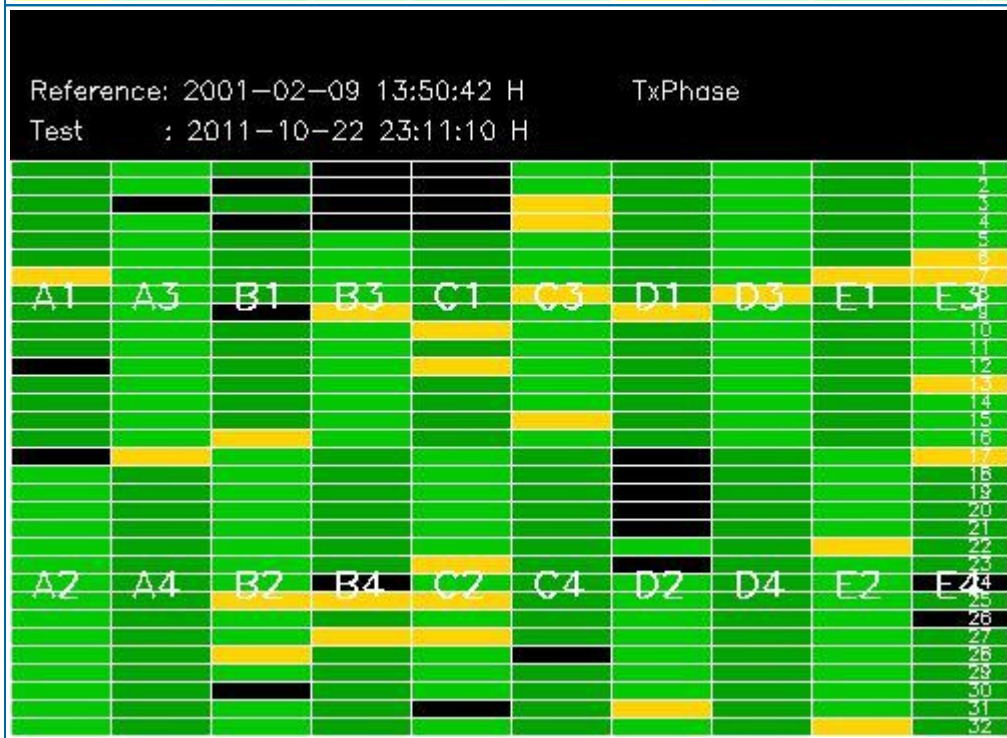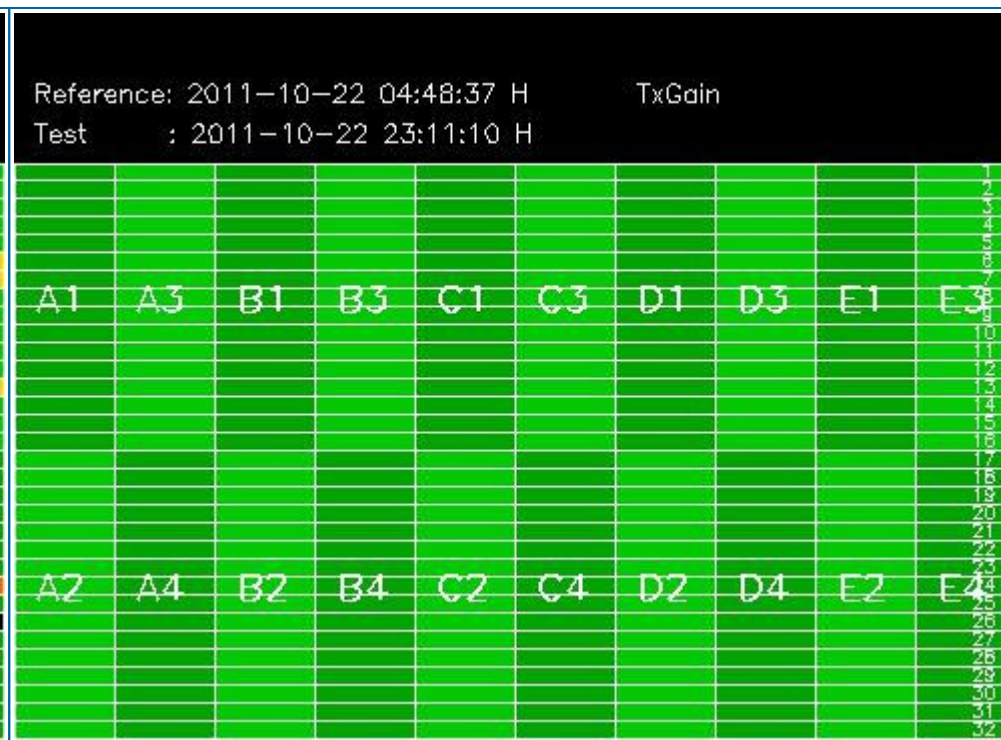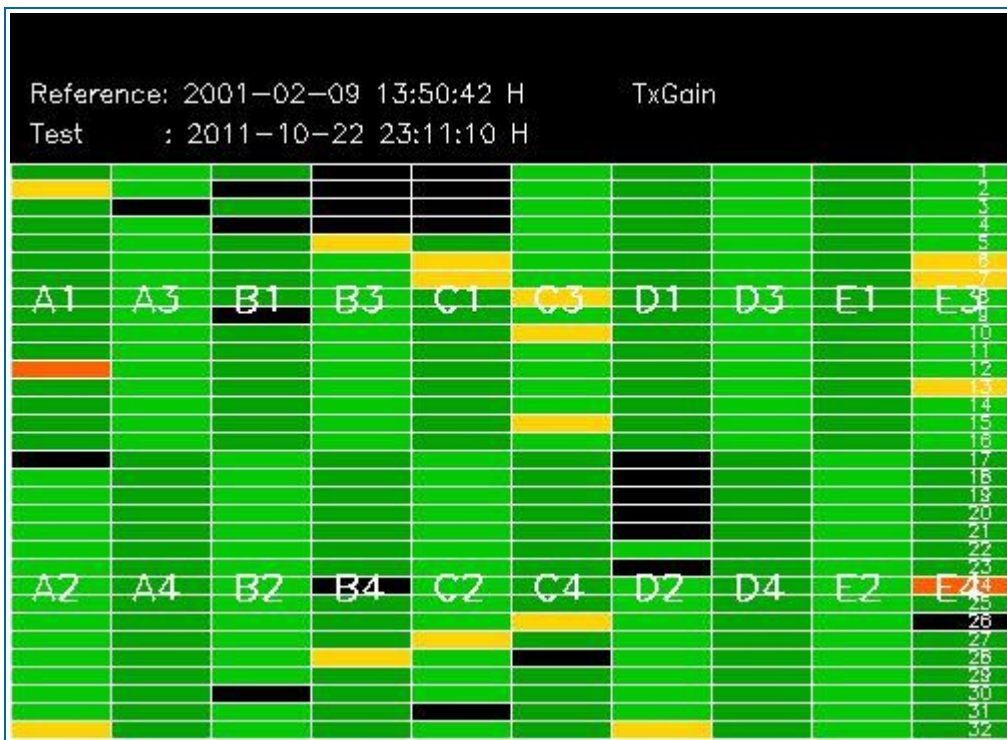

4 - CALIBRATION PULSES ANALYSIS

4.1 - Analysis for WVS IS2 V/V


4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for WVS IS2 V/V

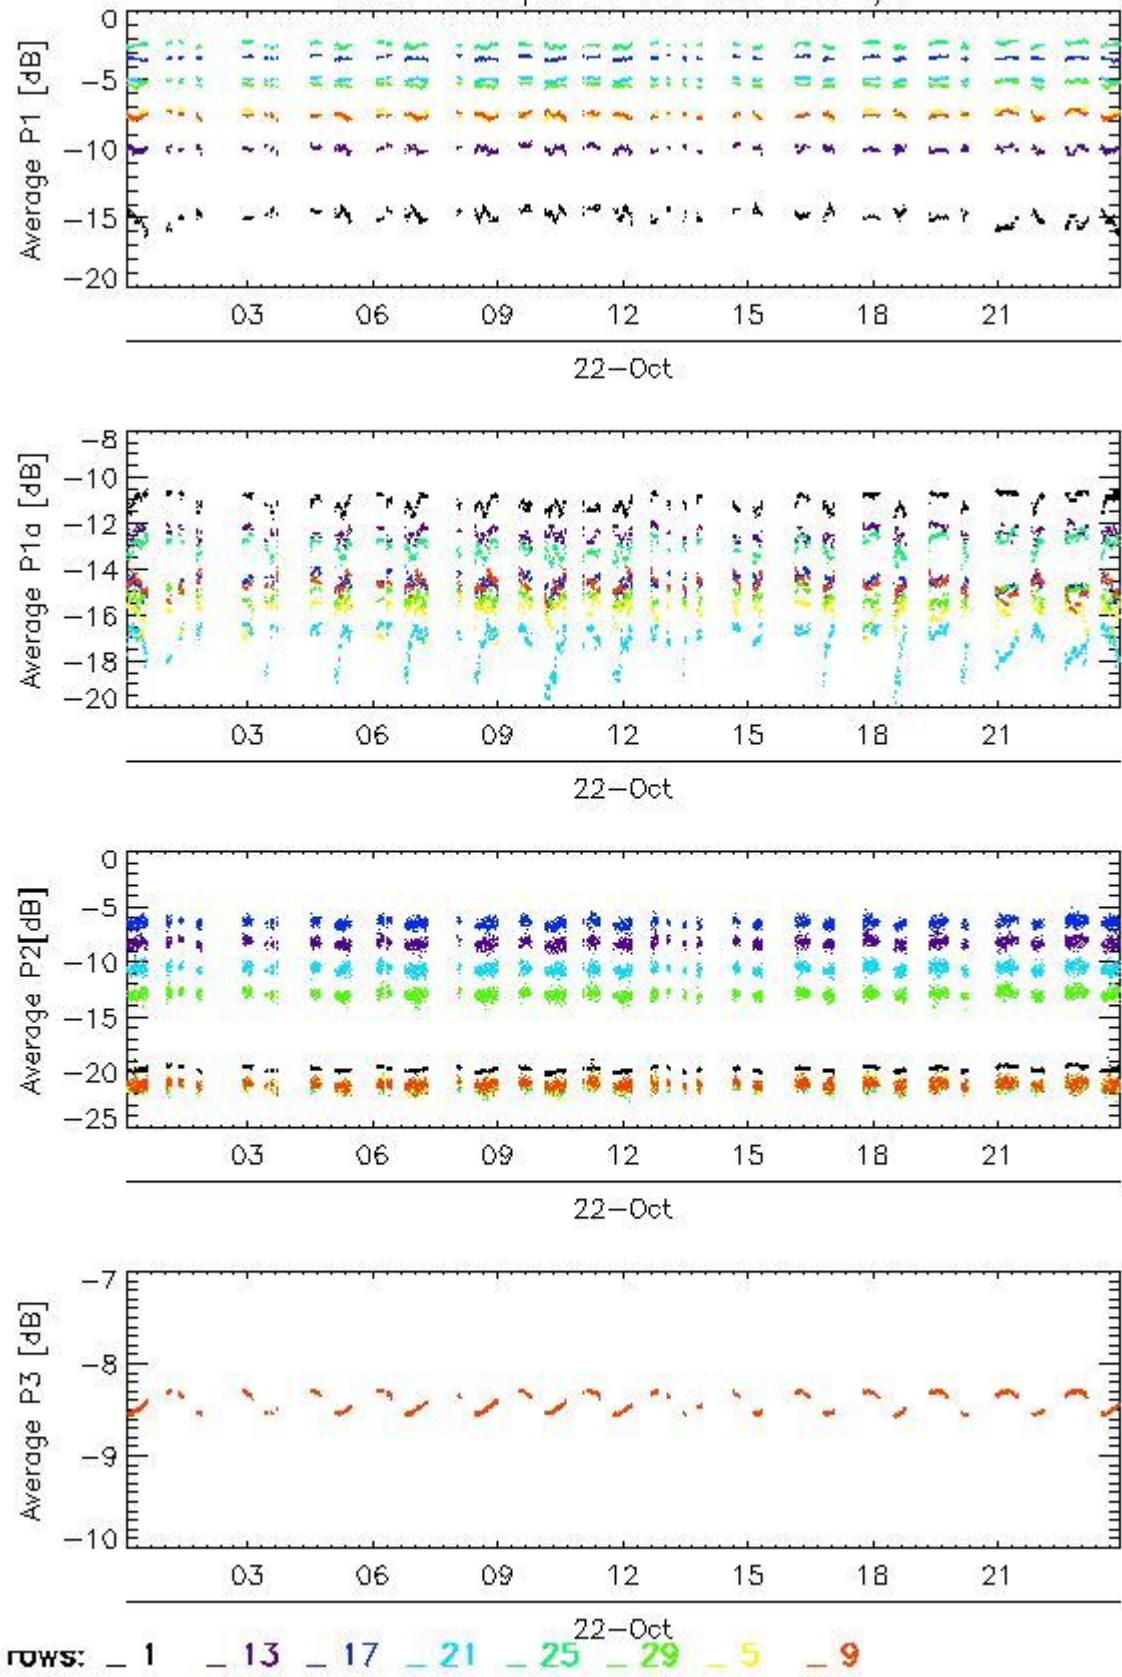


Transmit power (P1 - P1a) for WVS IS2 V/V

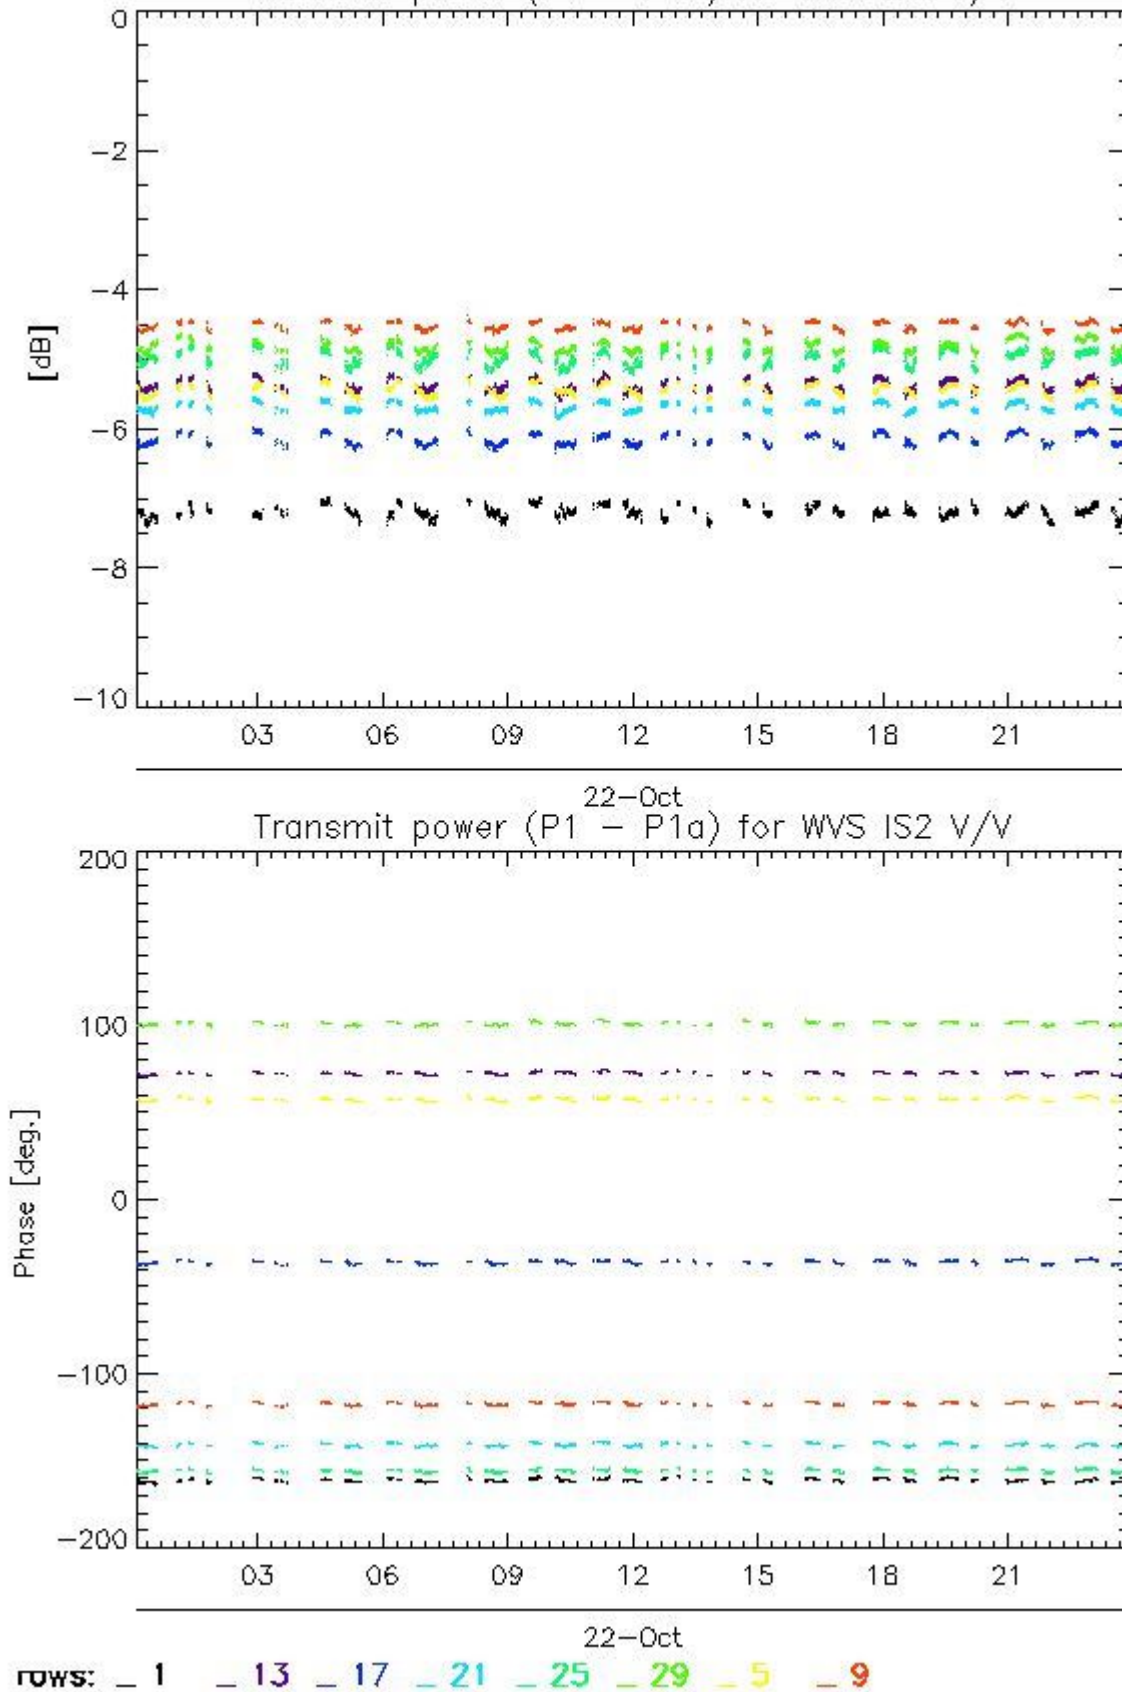

4.1.2 - All Rows Analysis for WVS IS2 V/V

[BACK TO MENU]



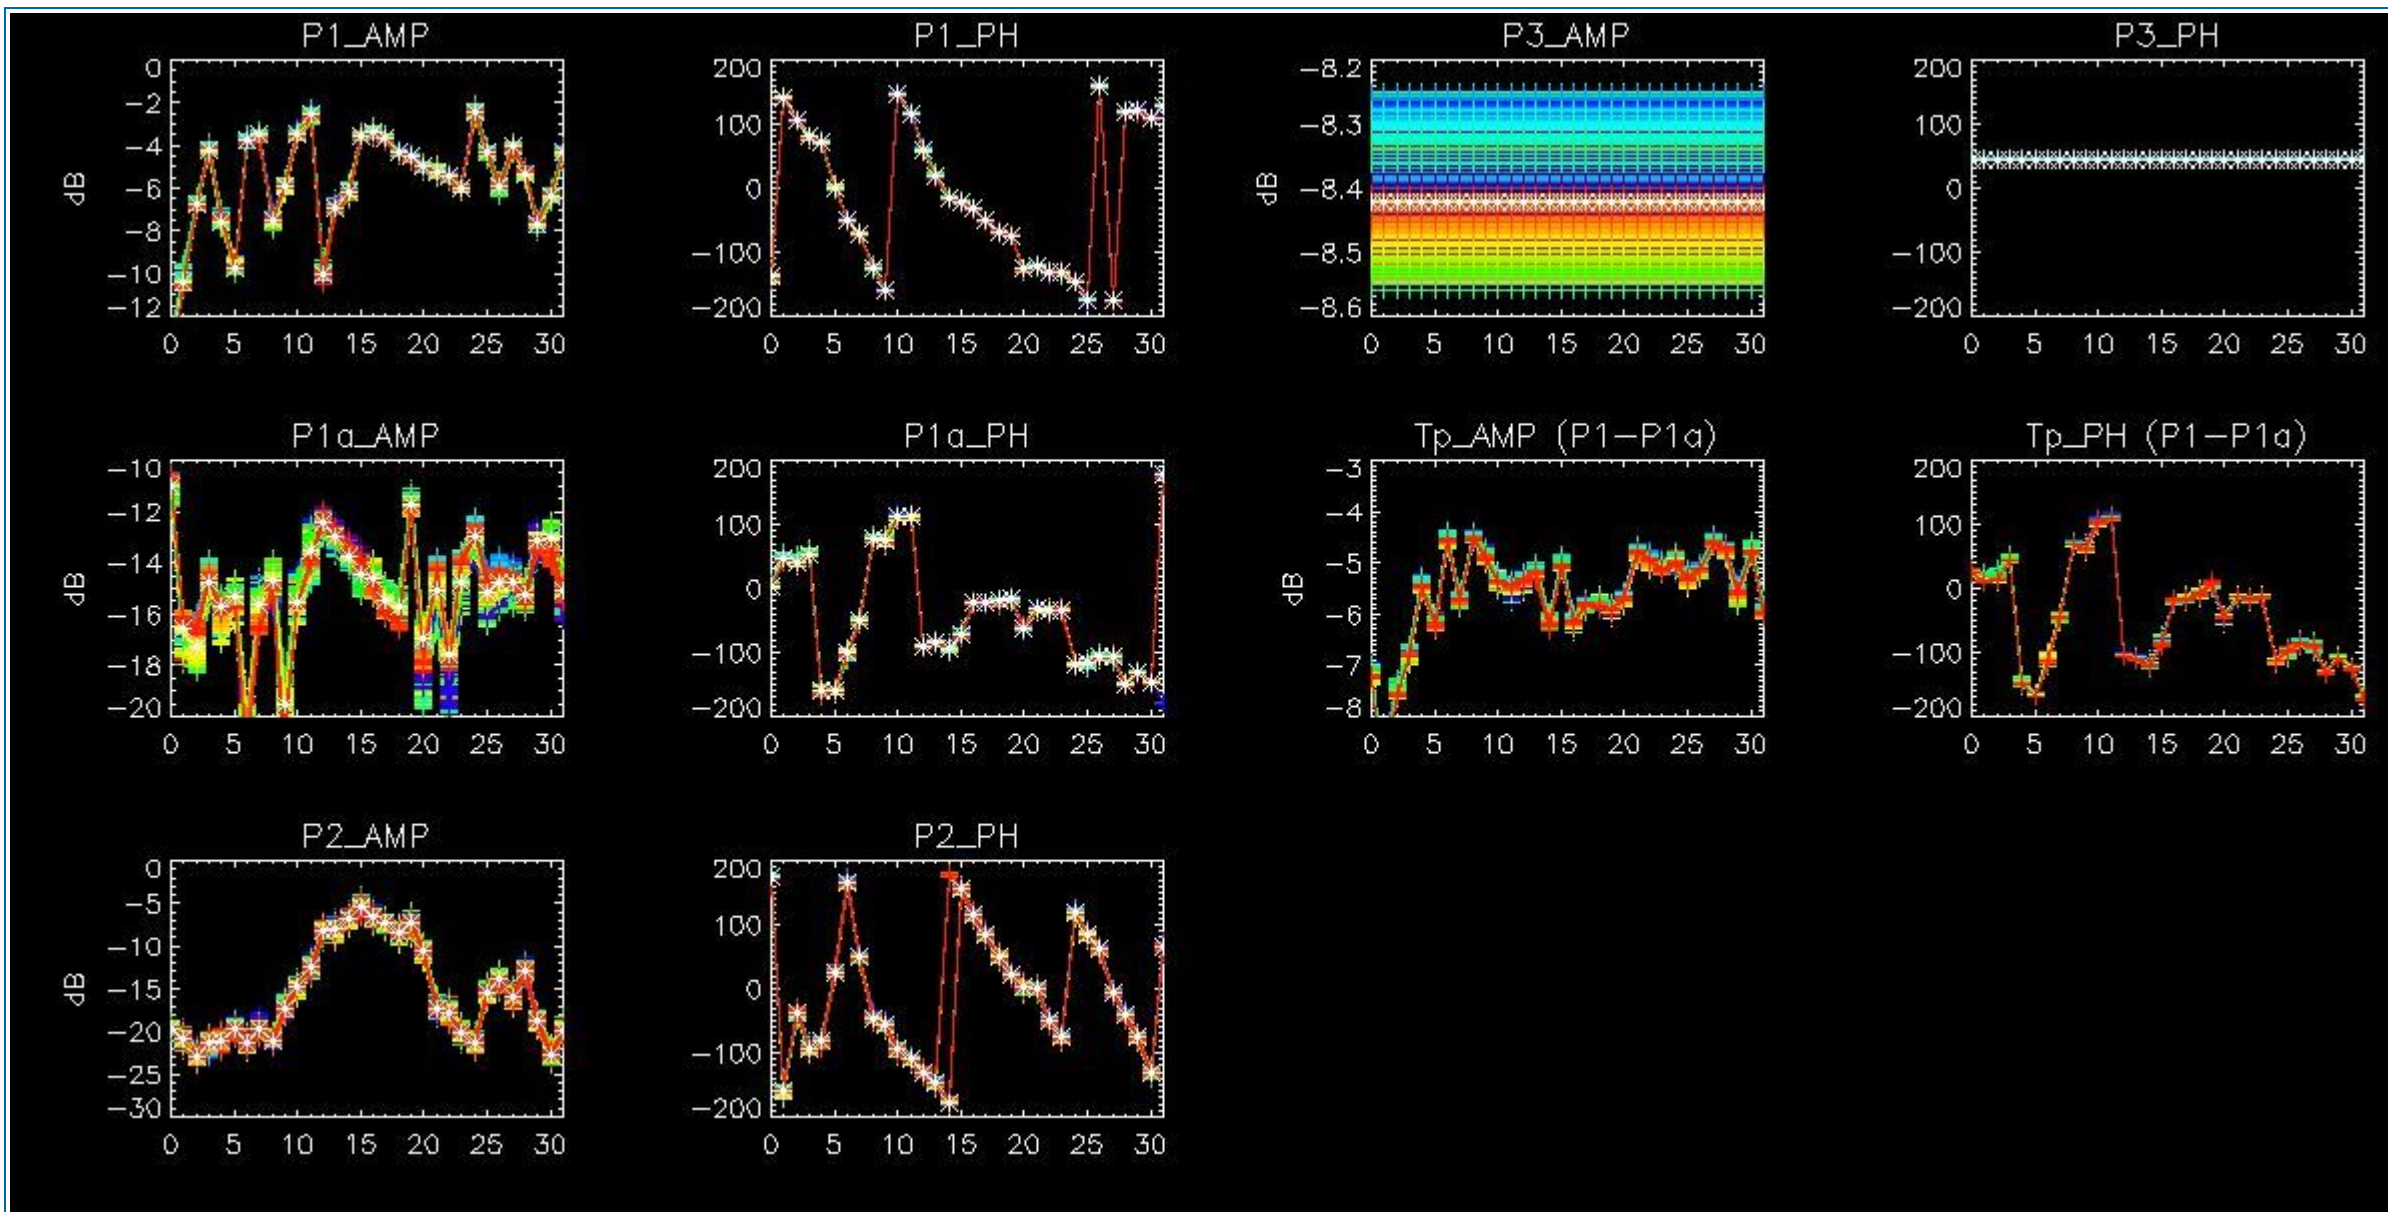

4.2 - Analysis for GM1 SS3 H/H


4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for GM1 SS3 H/H

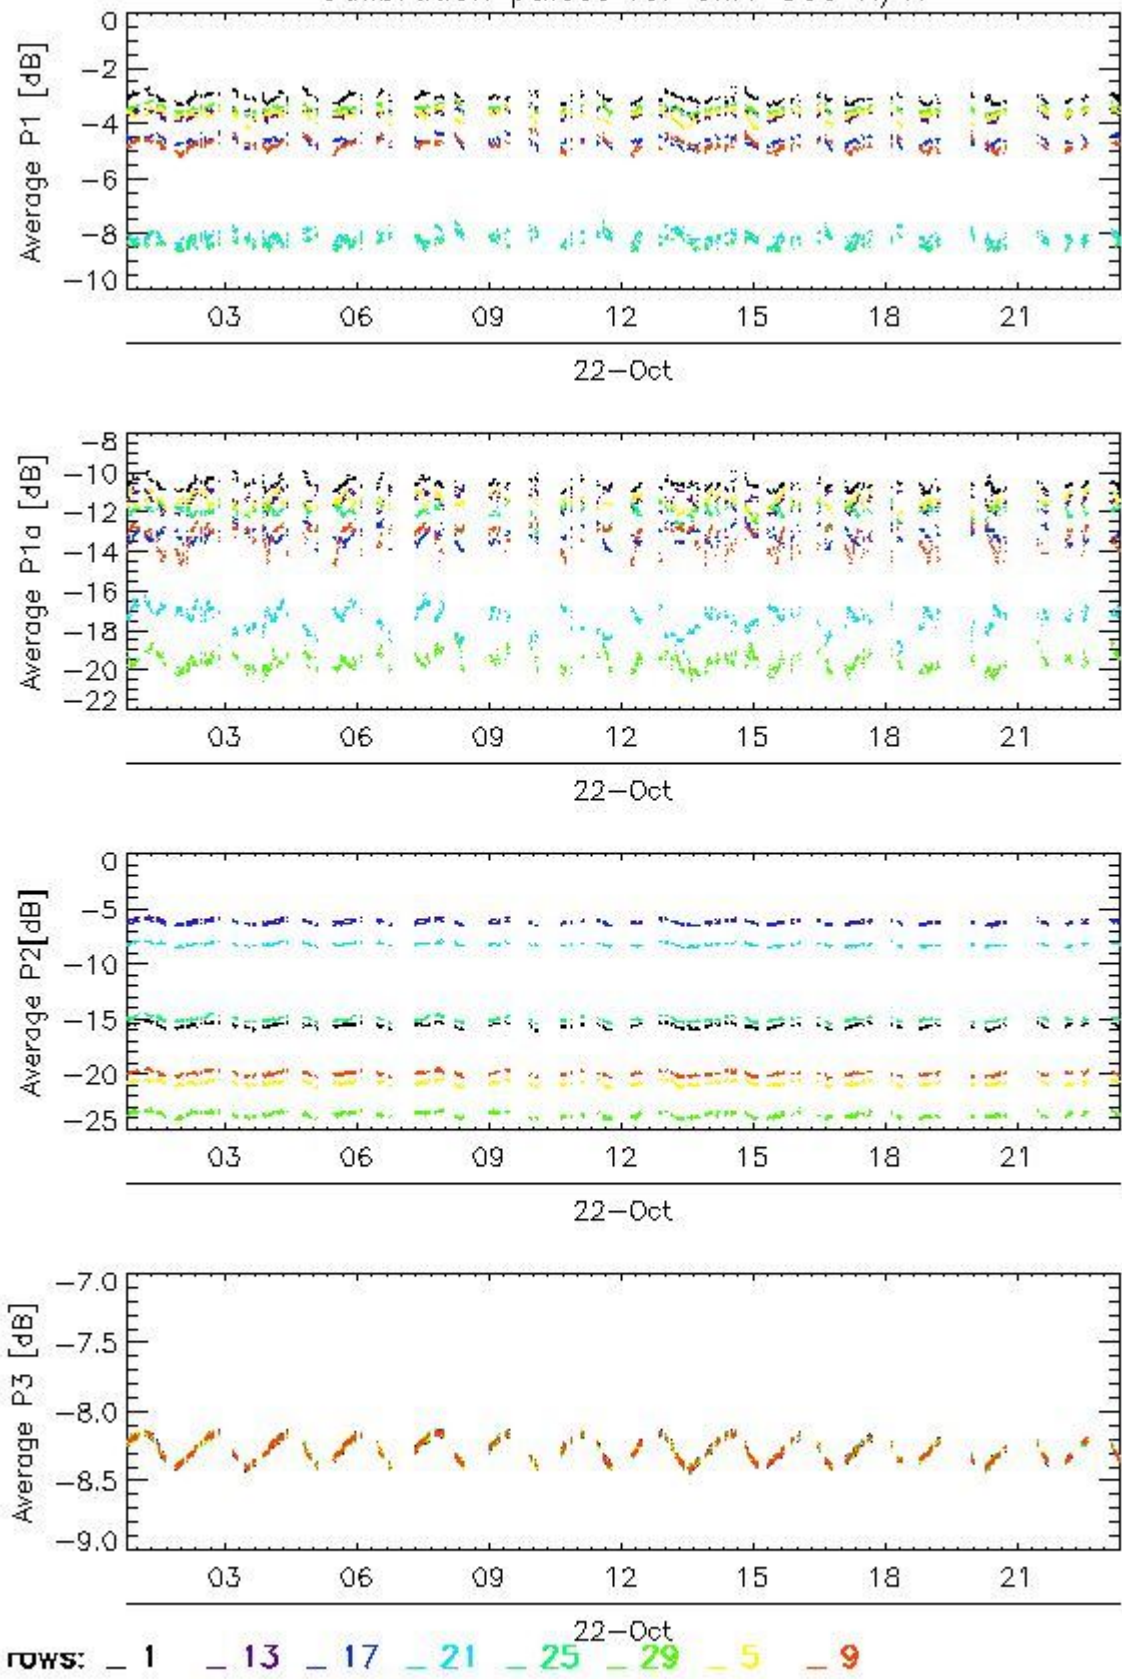


Transmit power (P1 - P1a) for GM1 SS3 H/H

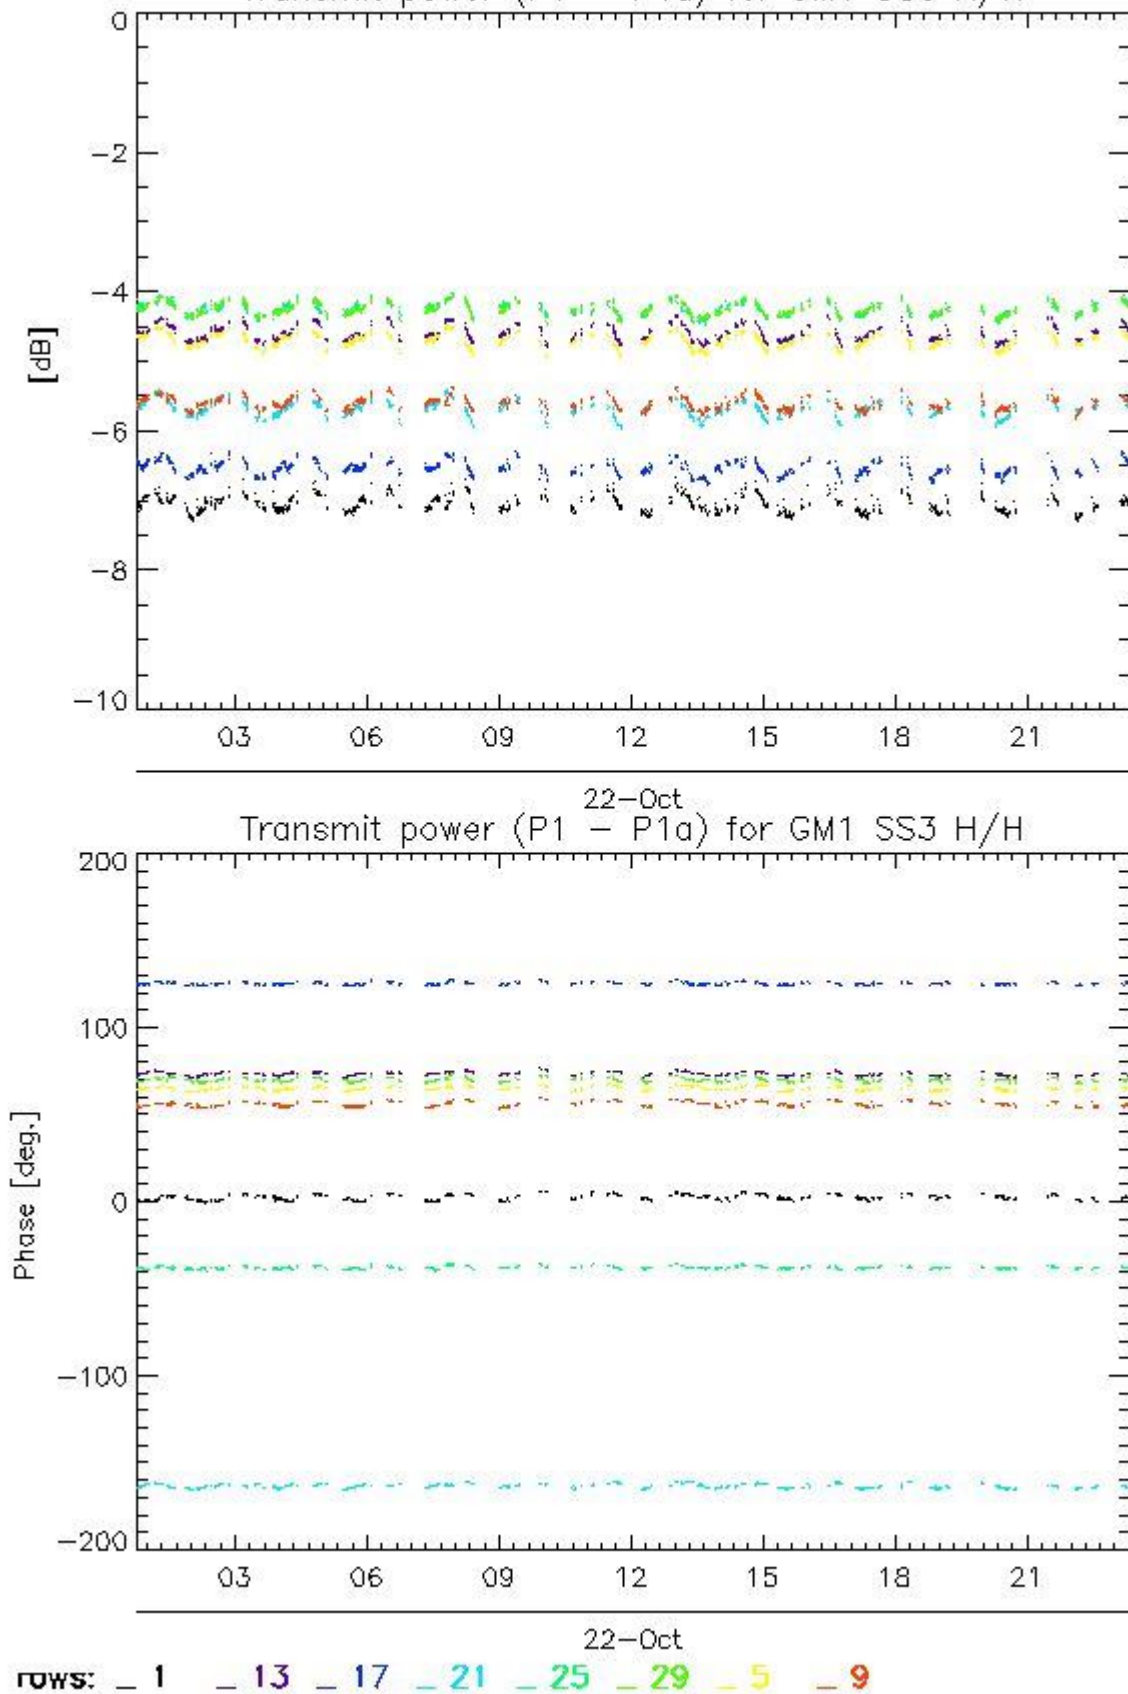

4.2.2 - All Rows Analysis for GM1 SS3 H/H

[BACK TO MENU]



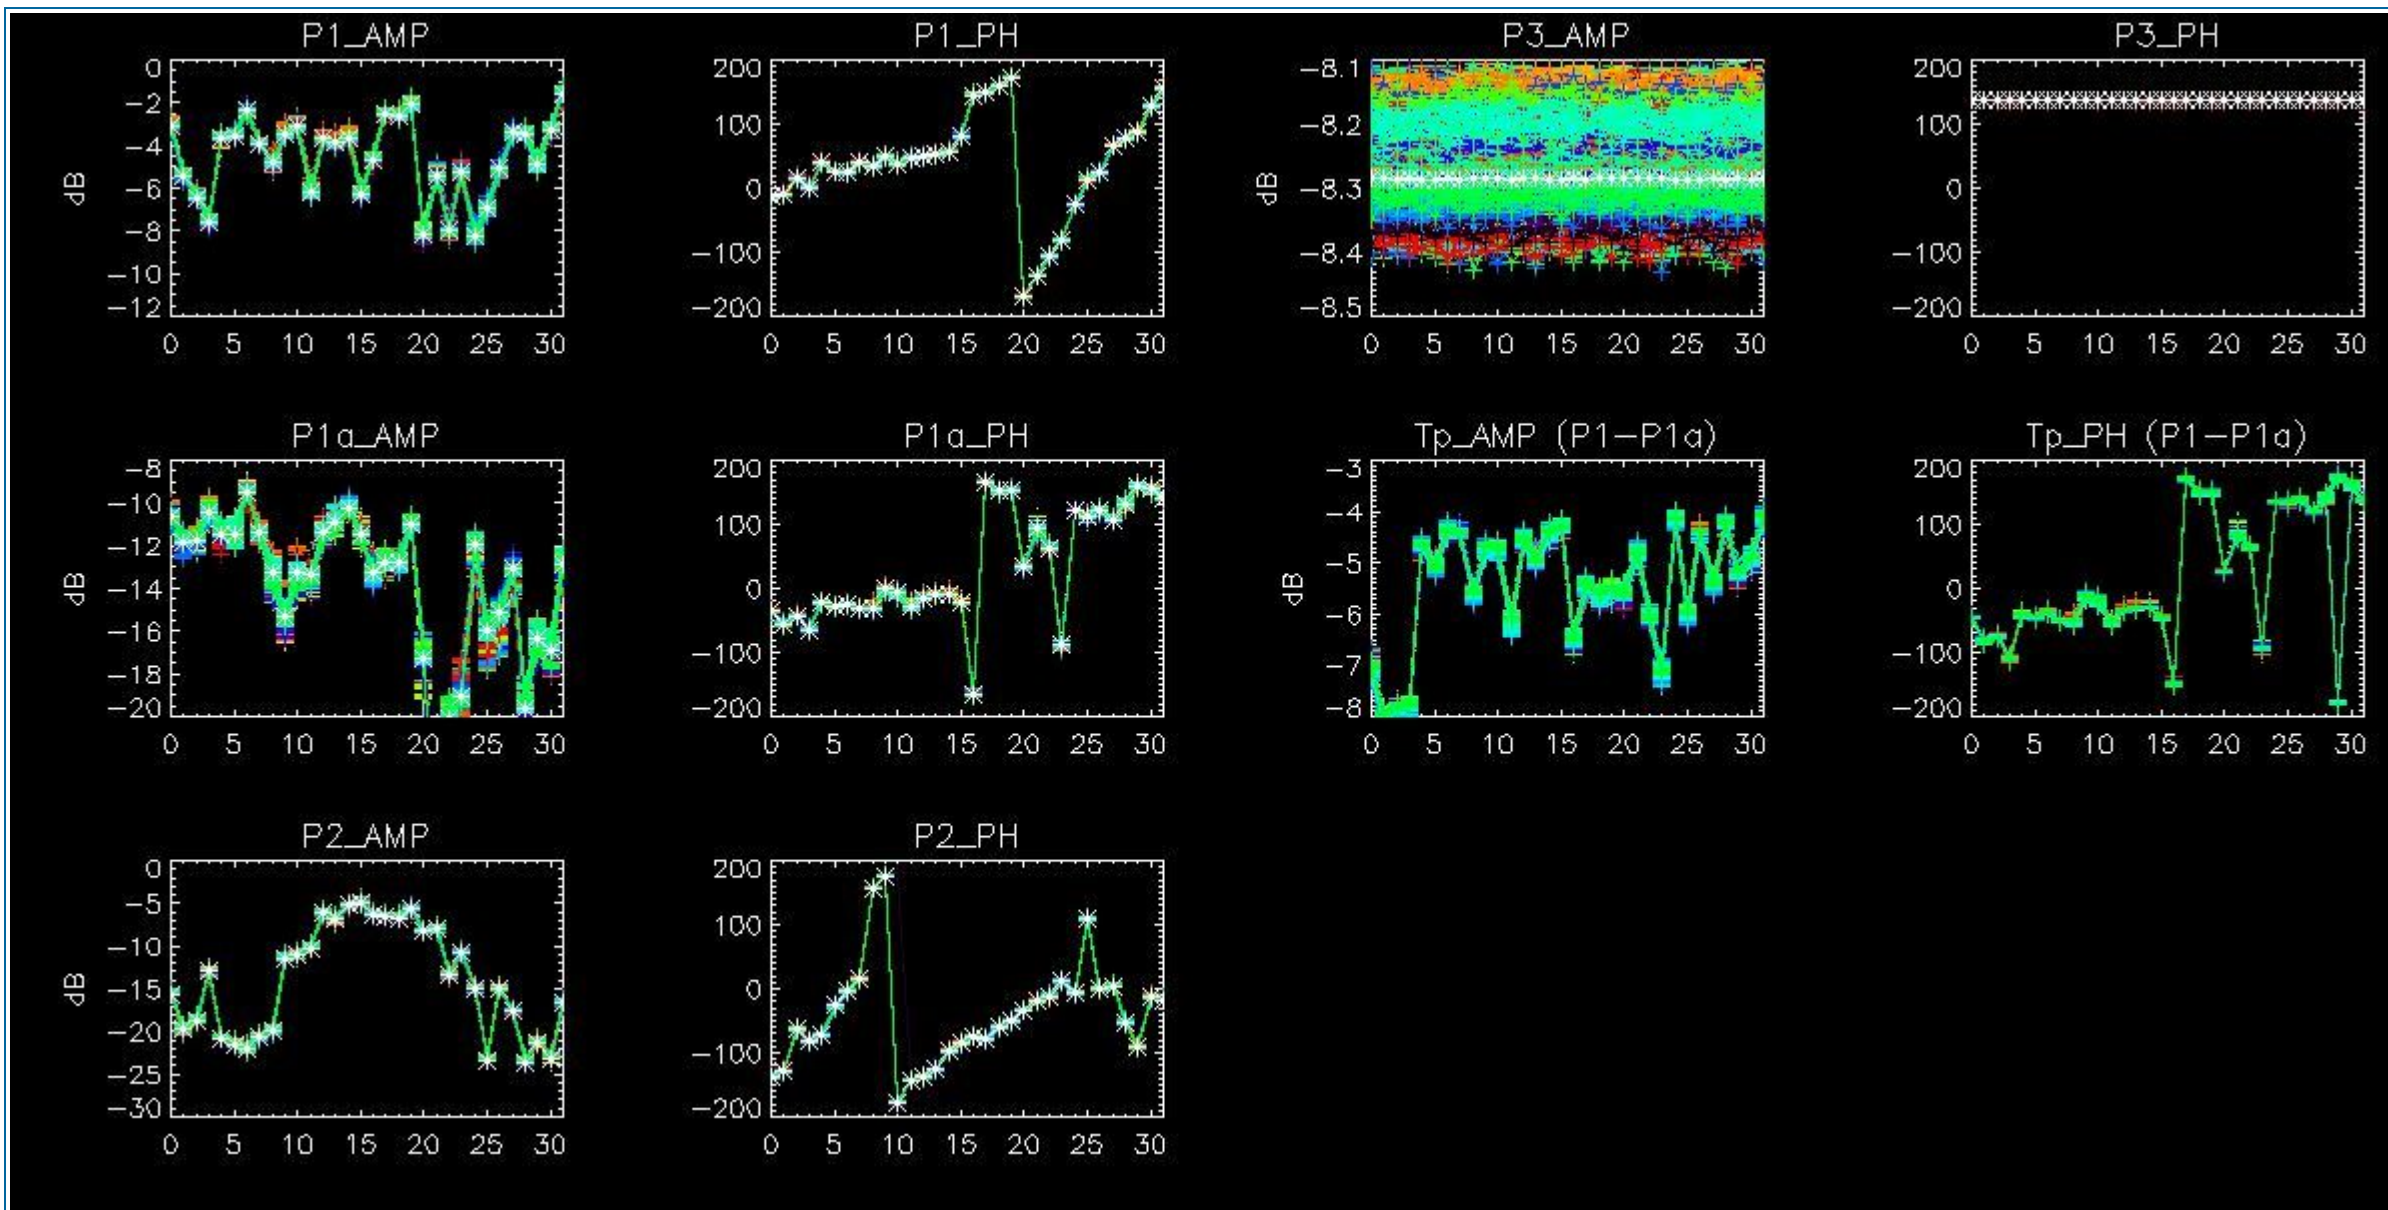


5 - DOPPLER ANALYSIS

5.1 - Analysis for WVS IS2 V/V

5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]




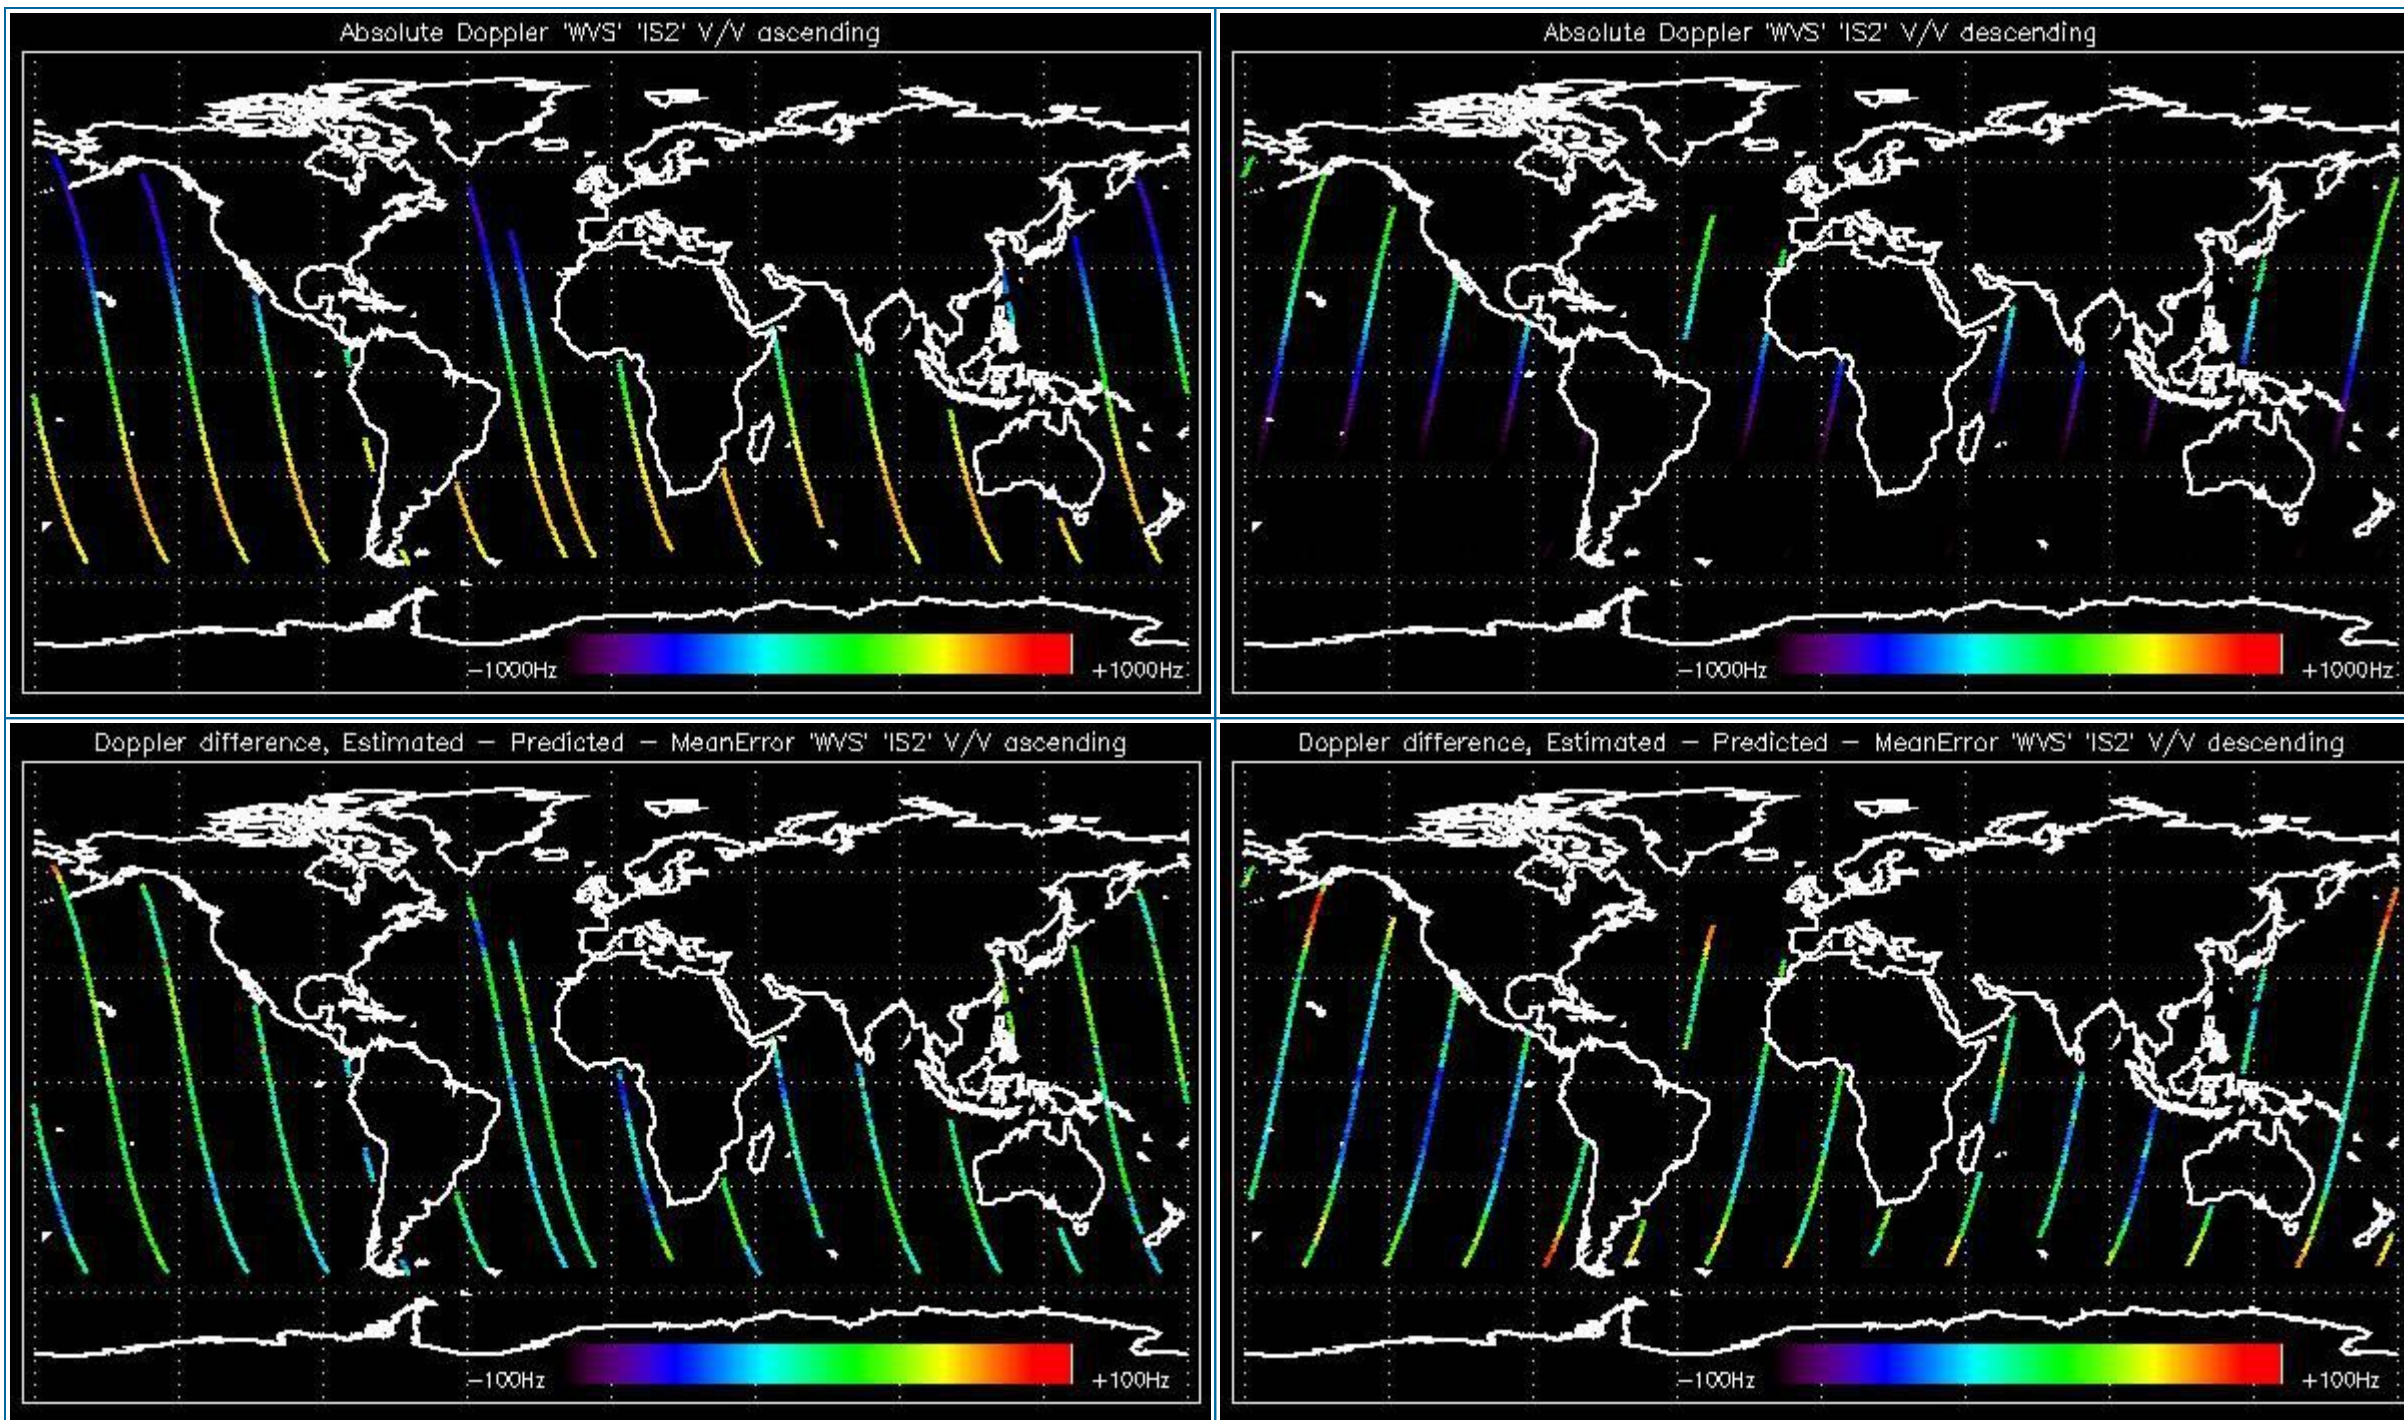

5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



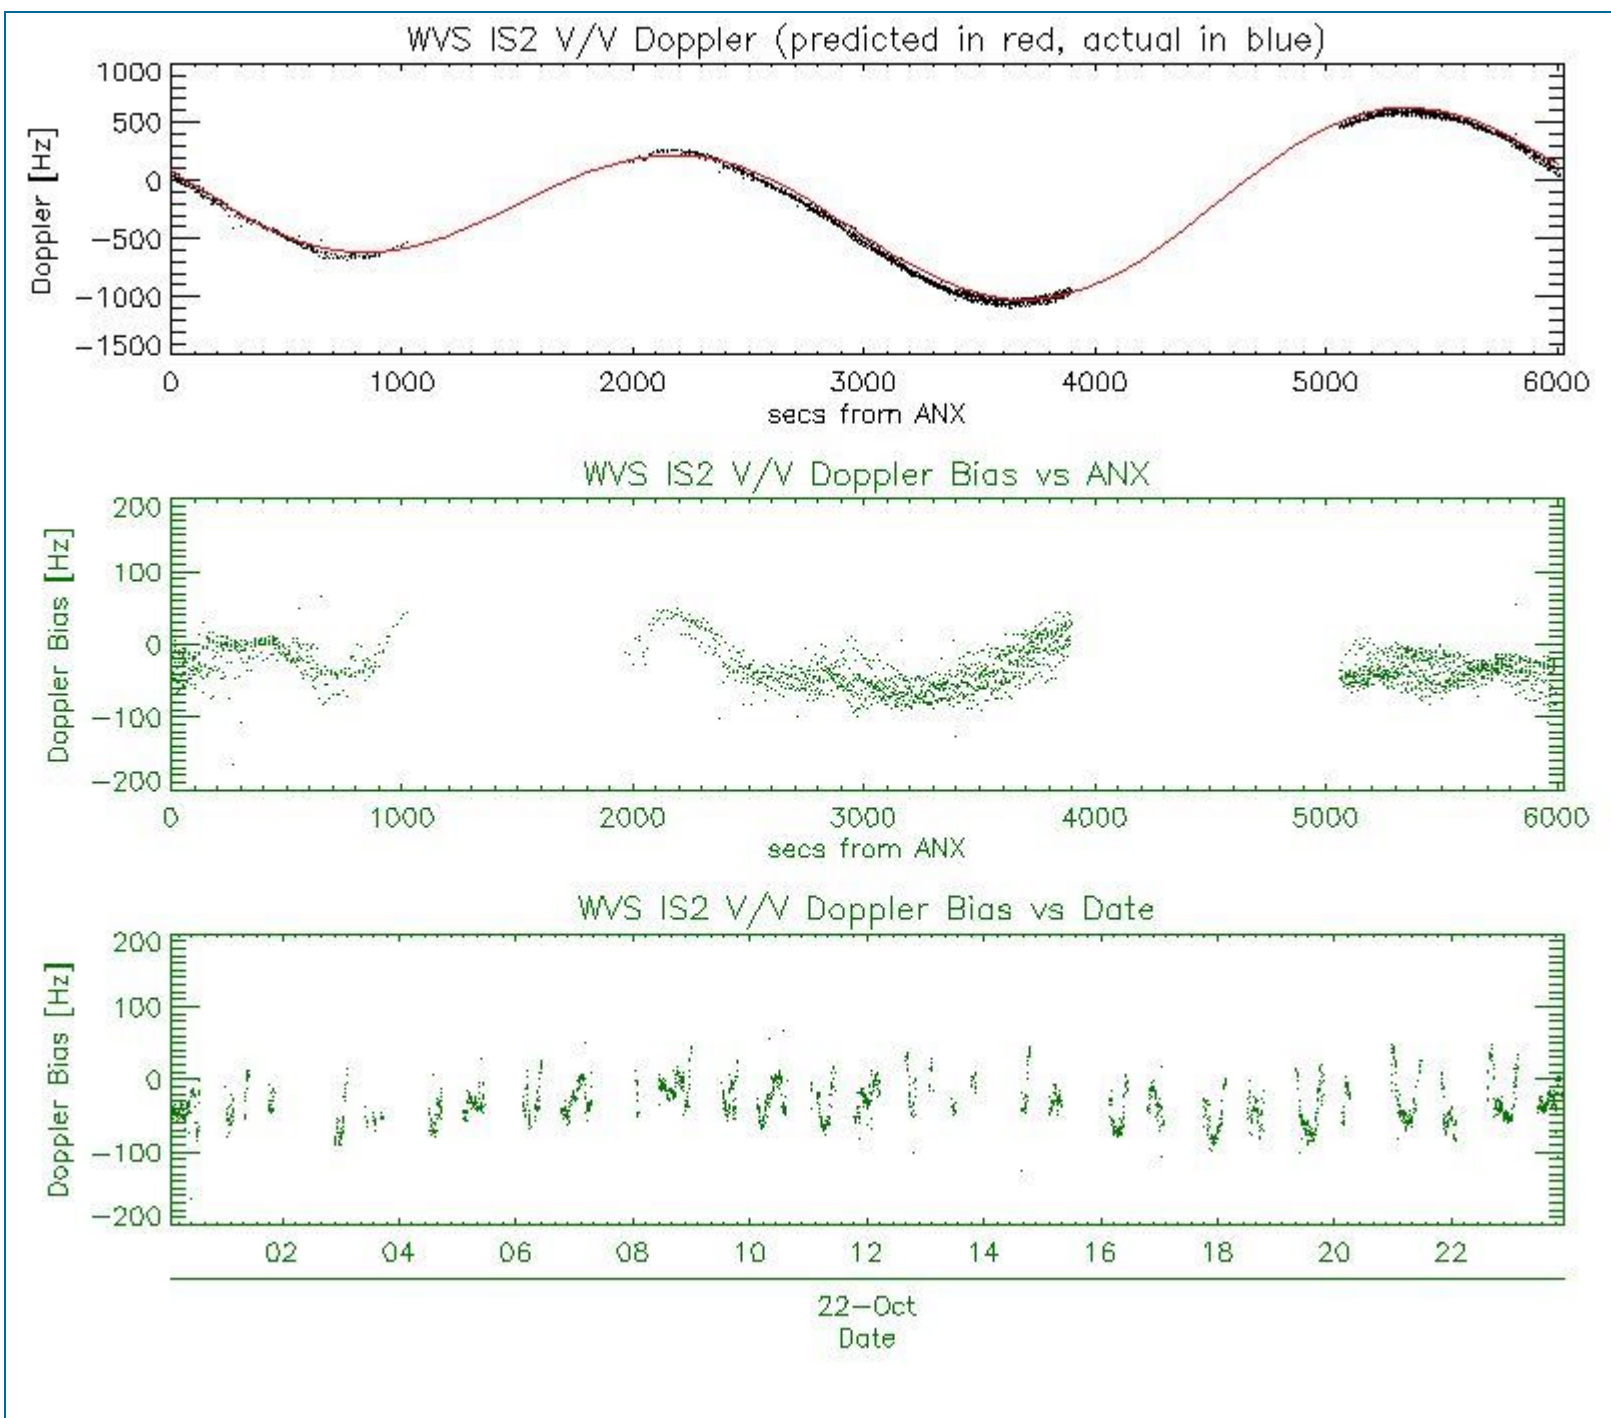


5.2 - Analysis for GM1 SS1 H/H

5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




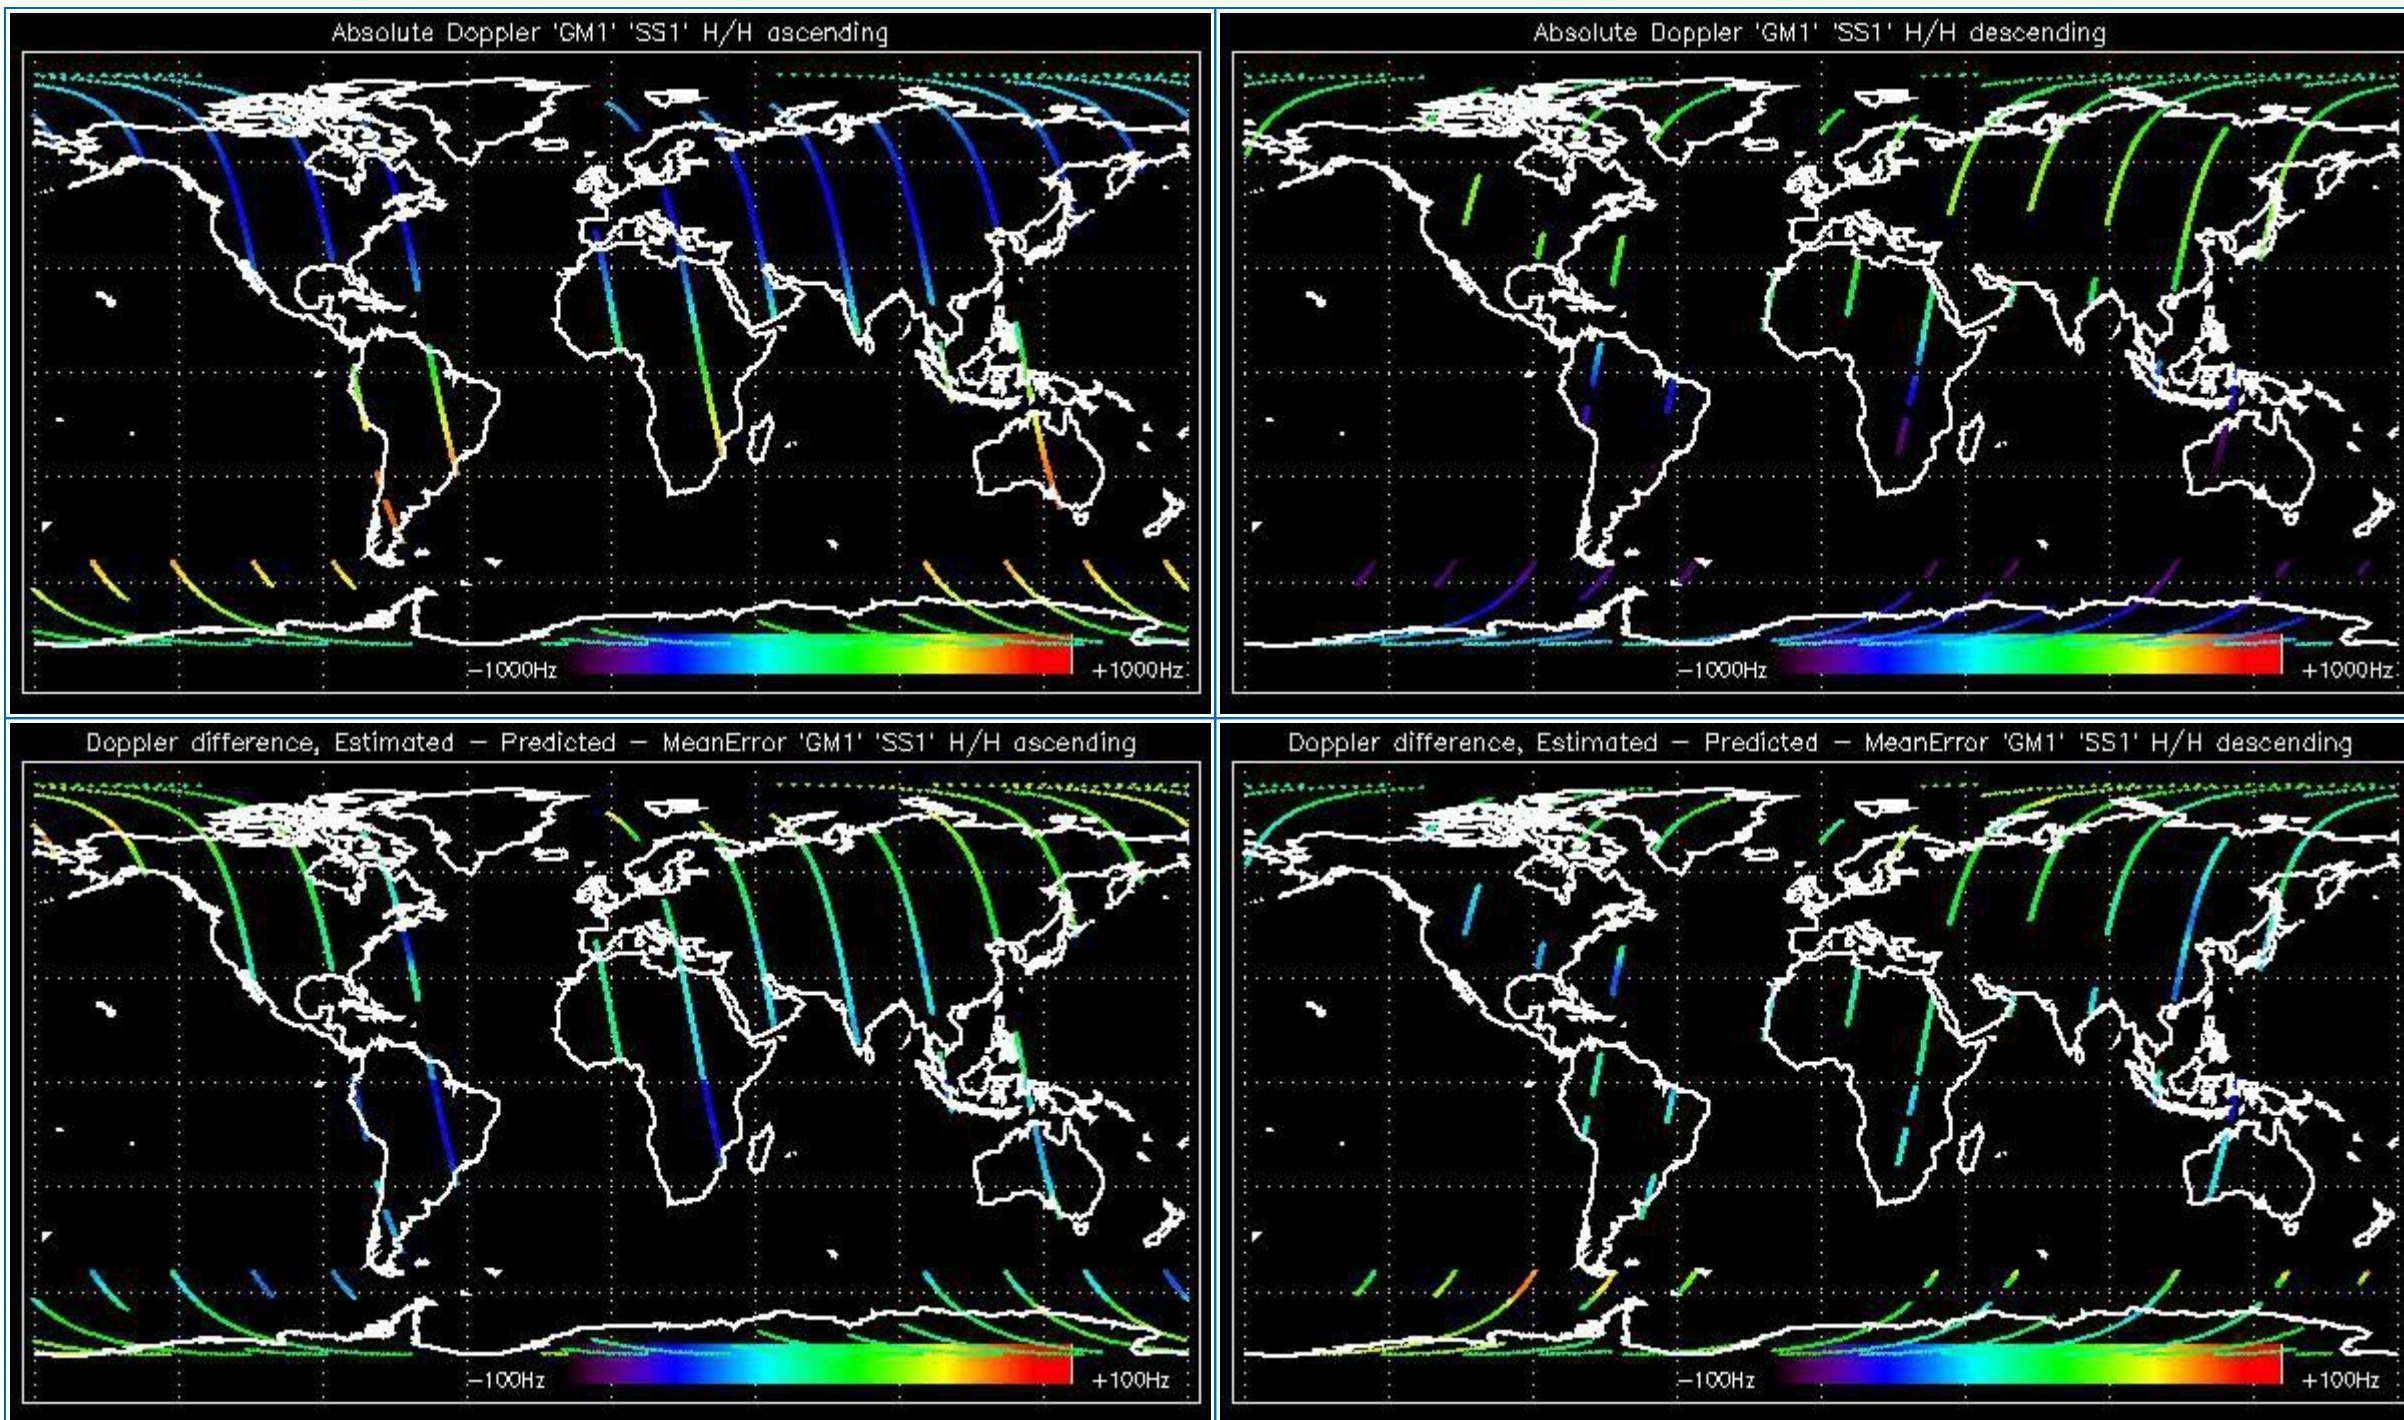

5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




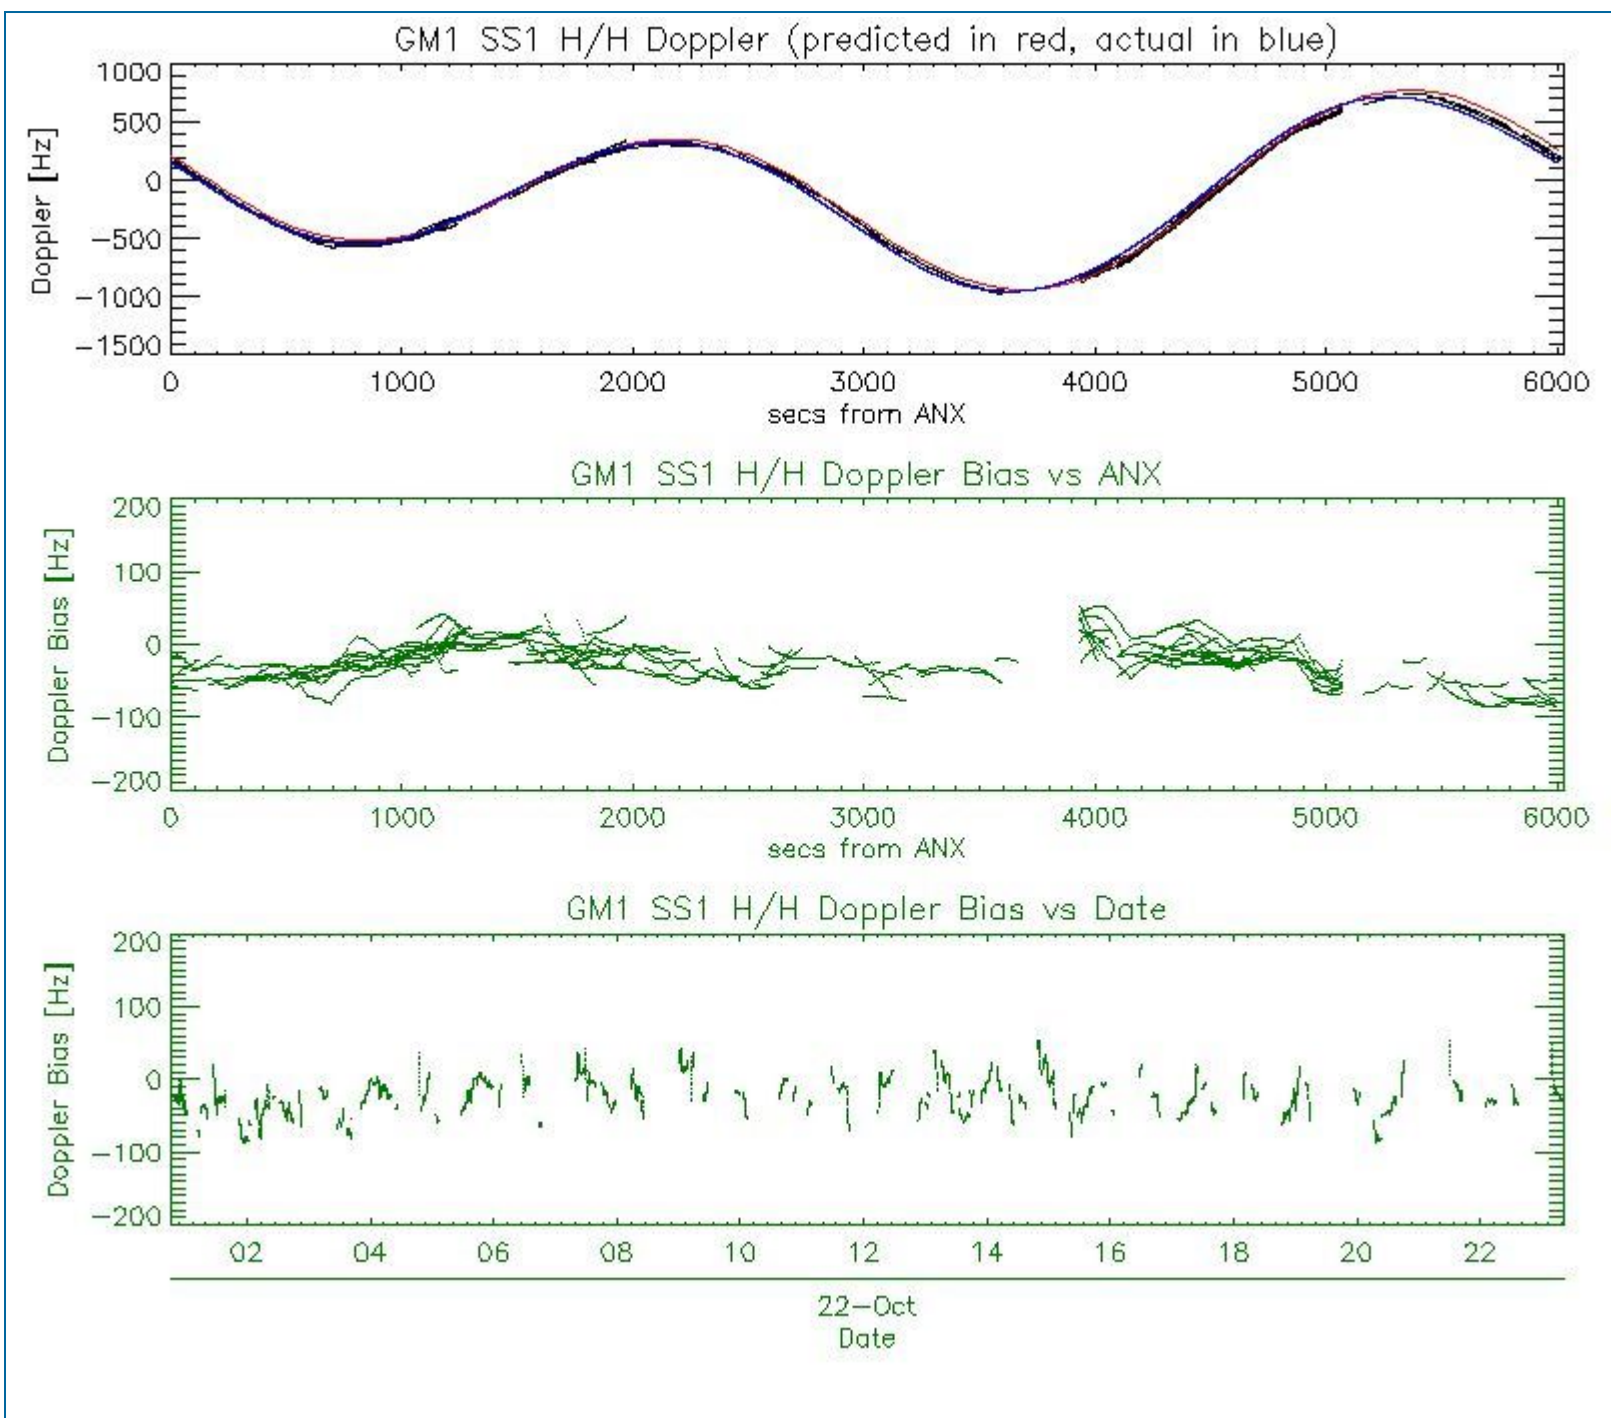

5.3 - Doppler JUMPS Analysis for WSM

[[BACK TO MENU](#)]



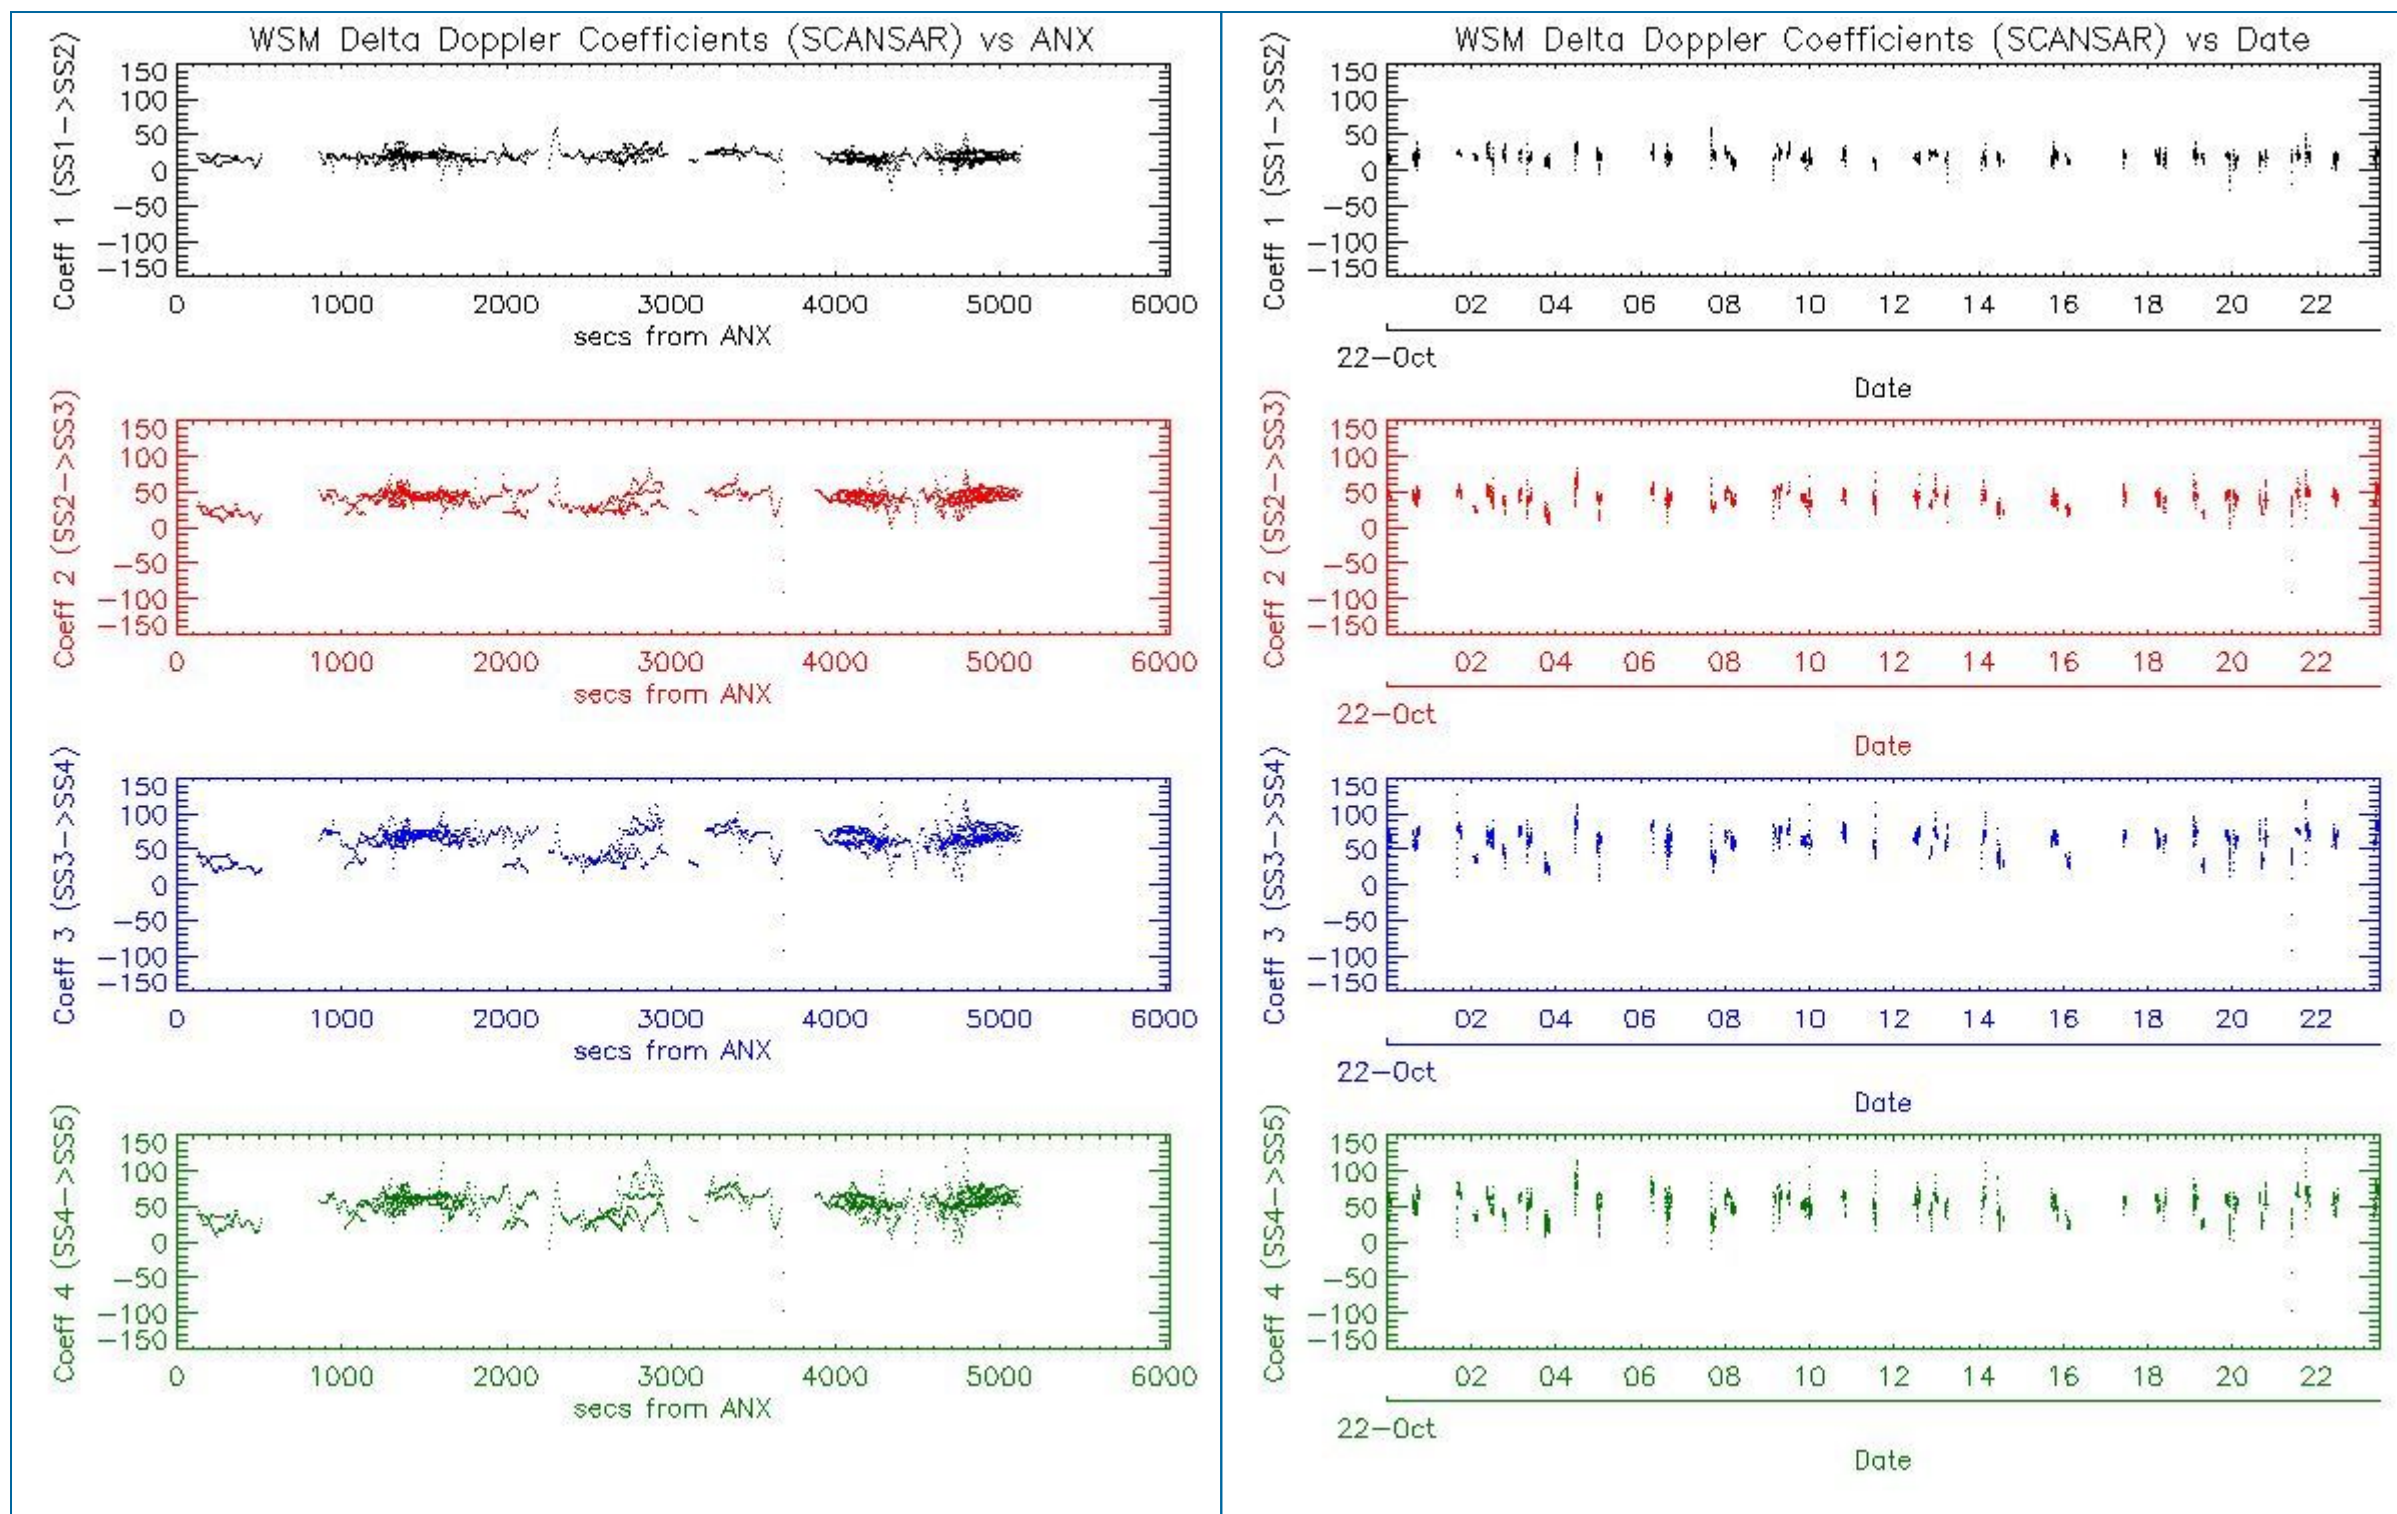



6 - CHIRP ANALYSIS

6.1 - Analysis for WSM SS1 H/H

6.1.1 - ScaleFactor

[[BACK TO MENU](#)]





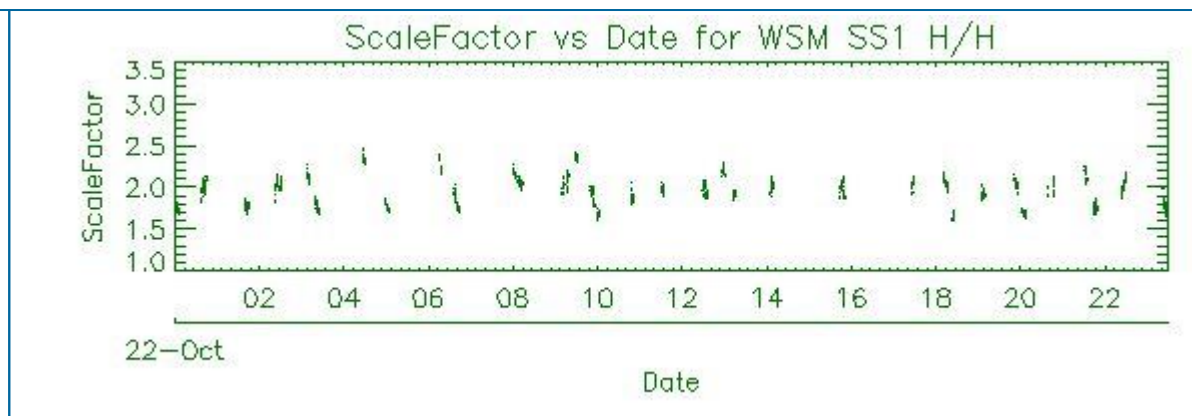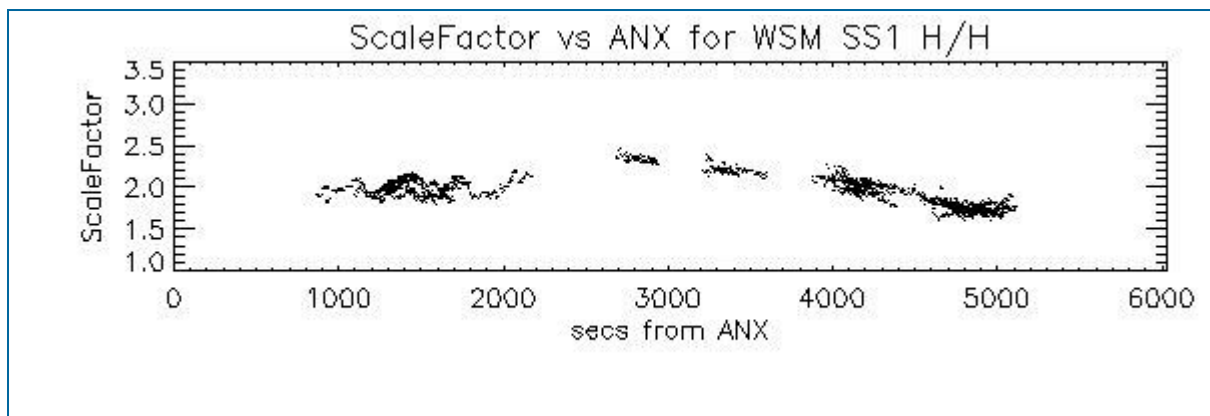

6.2 - Analysis for WSM SS1 V/V

6.2.1 - ScaleFactor

[[BACK TO MENU](#)]


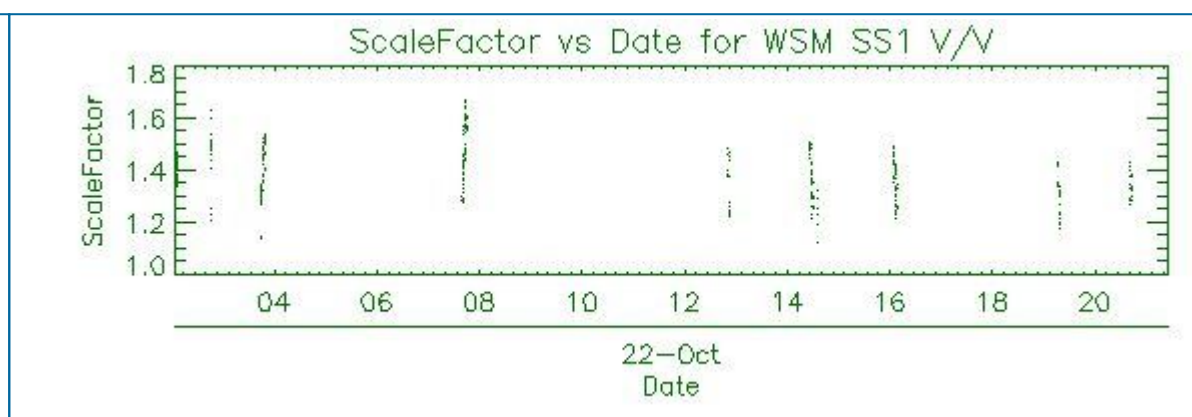
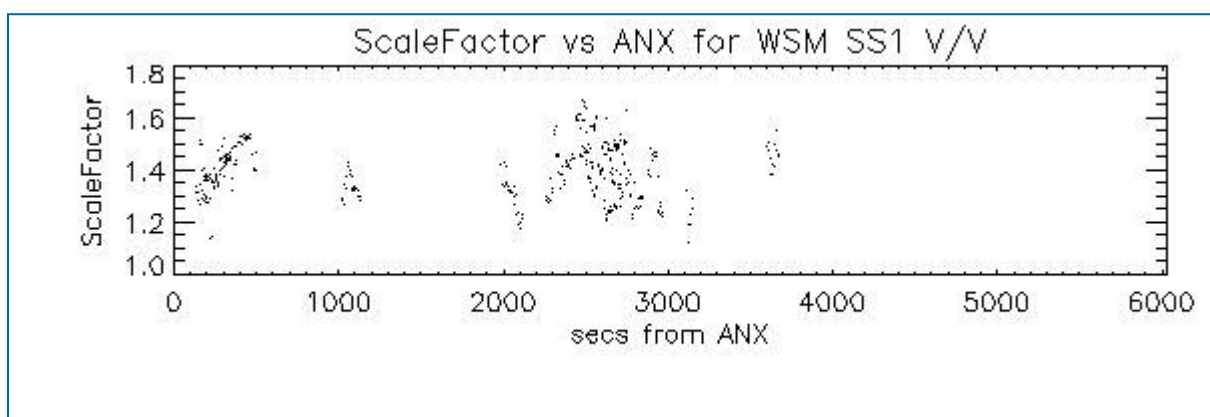


7 - RAW DATA ANALYSIS

7.1 - Analysis for WVS

[[BACK TO MENU](#)]

--	--	--

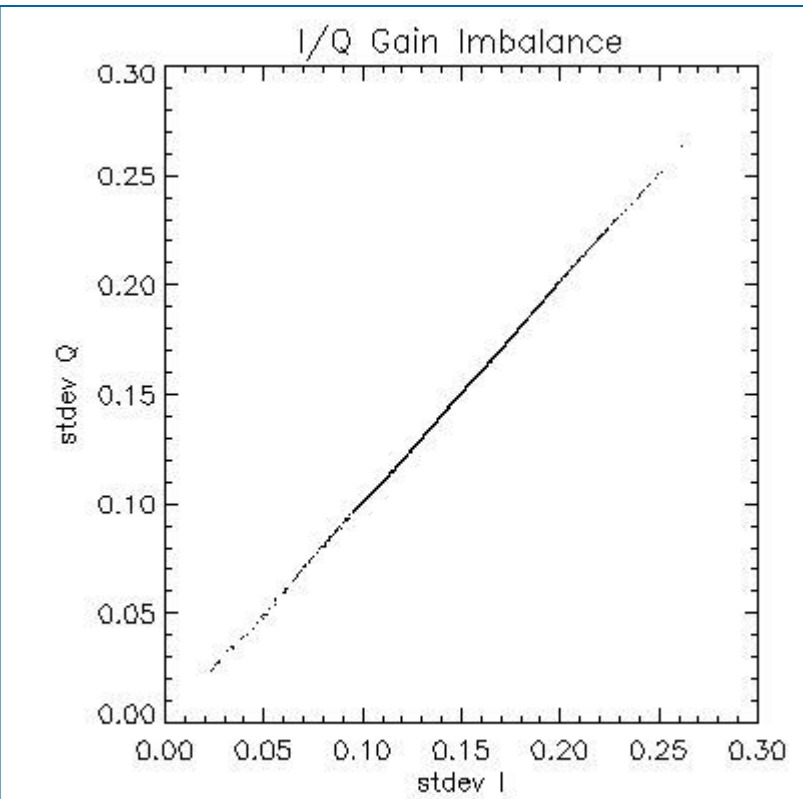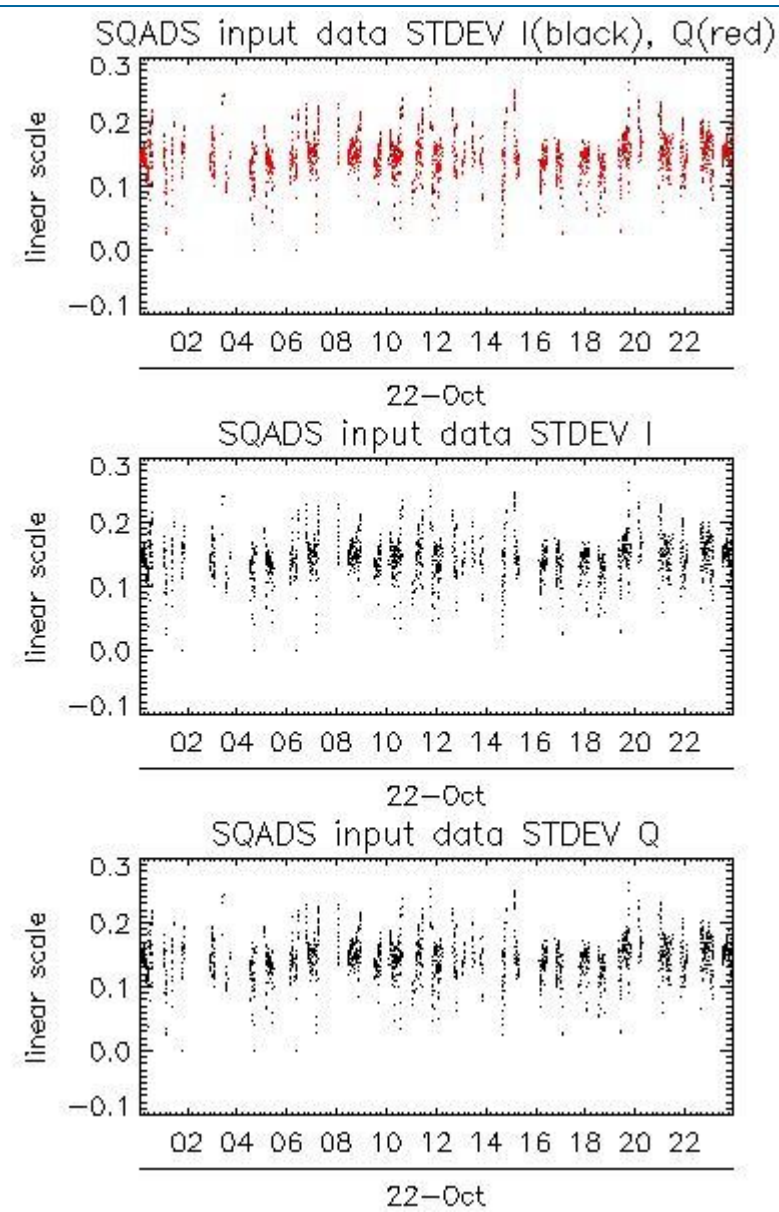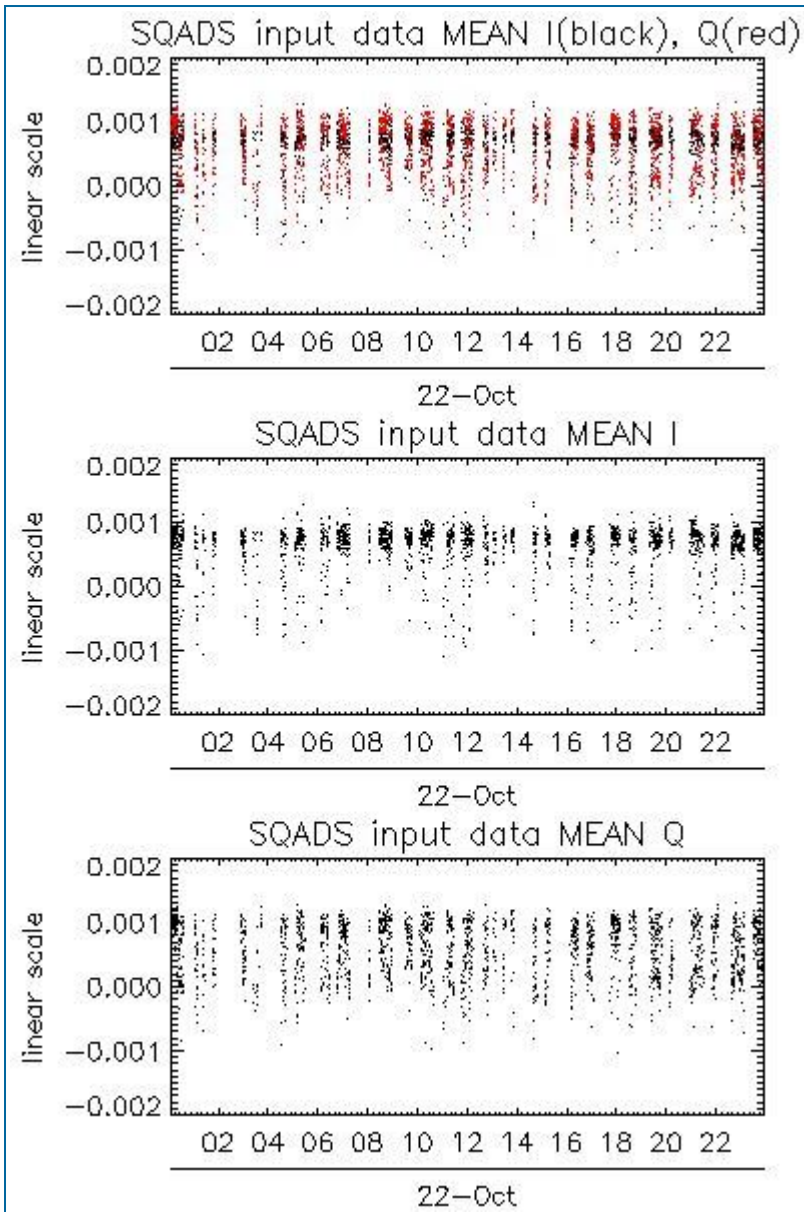


Channel	Statistics	DSS-B
MEAN I	mean	0.000632240
	stdev	1.24053e-07
MEAN Q	mean	0.000583866
	stdev	1.86059e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.144888
	stdev	0.000992848
STDEV Q	mean	0.145367
	stdev	0.00101293

7.2 - Analysis for IMM

[[BACK TO MENU](#)]



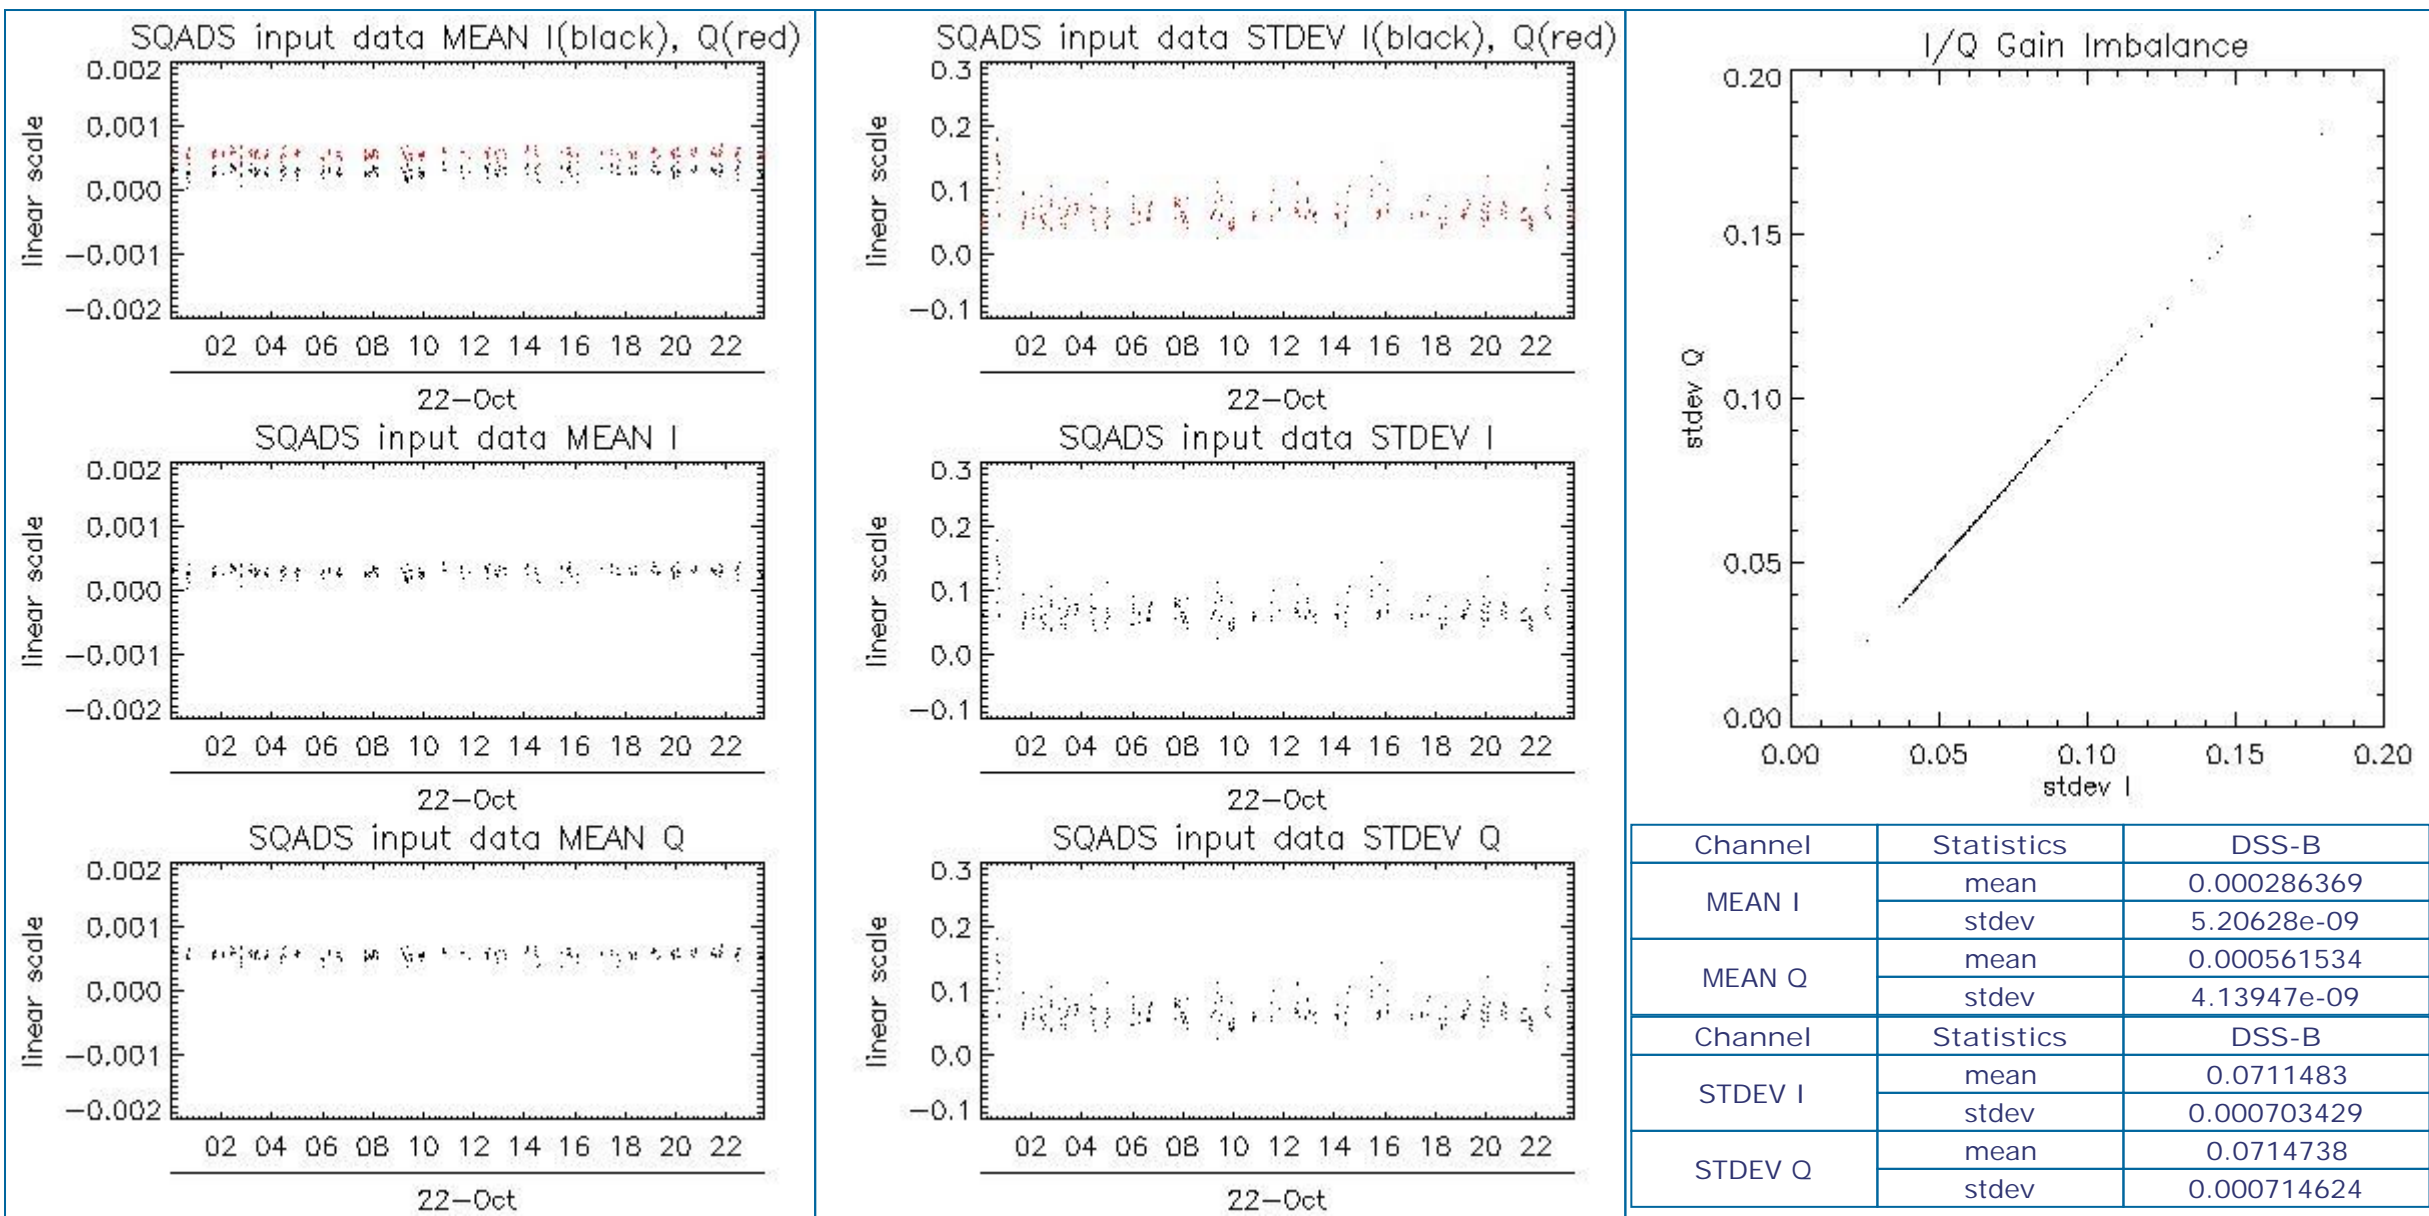


8 - TELEMETRY ANALYSIS

Processing Center	Product	Gaps	Missing lines
PDE	ASA_WVS_1PNPDE20111022_000551_000002703107_00418_50432_1274.N1	0	80
PDE	ASA_WVS_1PNPDE20111022_010214_000004873107_00419_50433_1302.N1	0	8
PDE	ASA_WVS_1PNPDE20111022_025321_000004793107_00420_50434_1334.N1	1	0
PDE	ASA_WVS_1PNPDE20111022_214930_000001803107_00431_50445_1577.N1	1	0
PDE	ASA_WVS_1PNPDE20111022_232909_000002103108_00001_50446_1589.N1	0	56
PDK	ASA_WVS_1PNPDK20111022_134641_000003413107_00427_50441_4751.N1	0	8
PDK	ASA_WVS_1PNPDK20111022_192033_000016793107_00430_50444_4855.N1	0	8
PDE	ASA_WSM_1PNPDE20111022_125041_000001103107_00426_50440_1527.N1	0	30
PDE	ASA_WSM_1PNPDE20111022_143448_000000613107_00427_50441_1536.N1	0	121
PDK	ASA_WSM_1PNPDK20111022_020326_000002453107_00420_50434_4572.N1	39	4234
PDK	ASA_WSM_1PNPDK20111022_034345_000003923107_00421_50435_4588.N1	0	68
PDK	ASA_WSM_1PNPDK20111022_160418_000002693107_00428_50442_4796.N1	0	1


8.1 - Number of Missing lines

[BACK TO MENU]

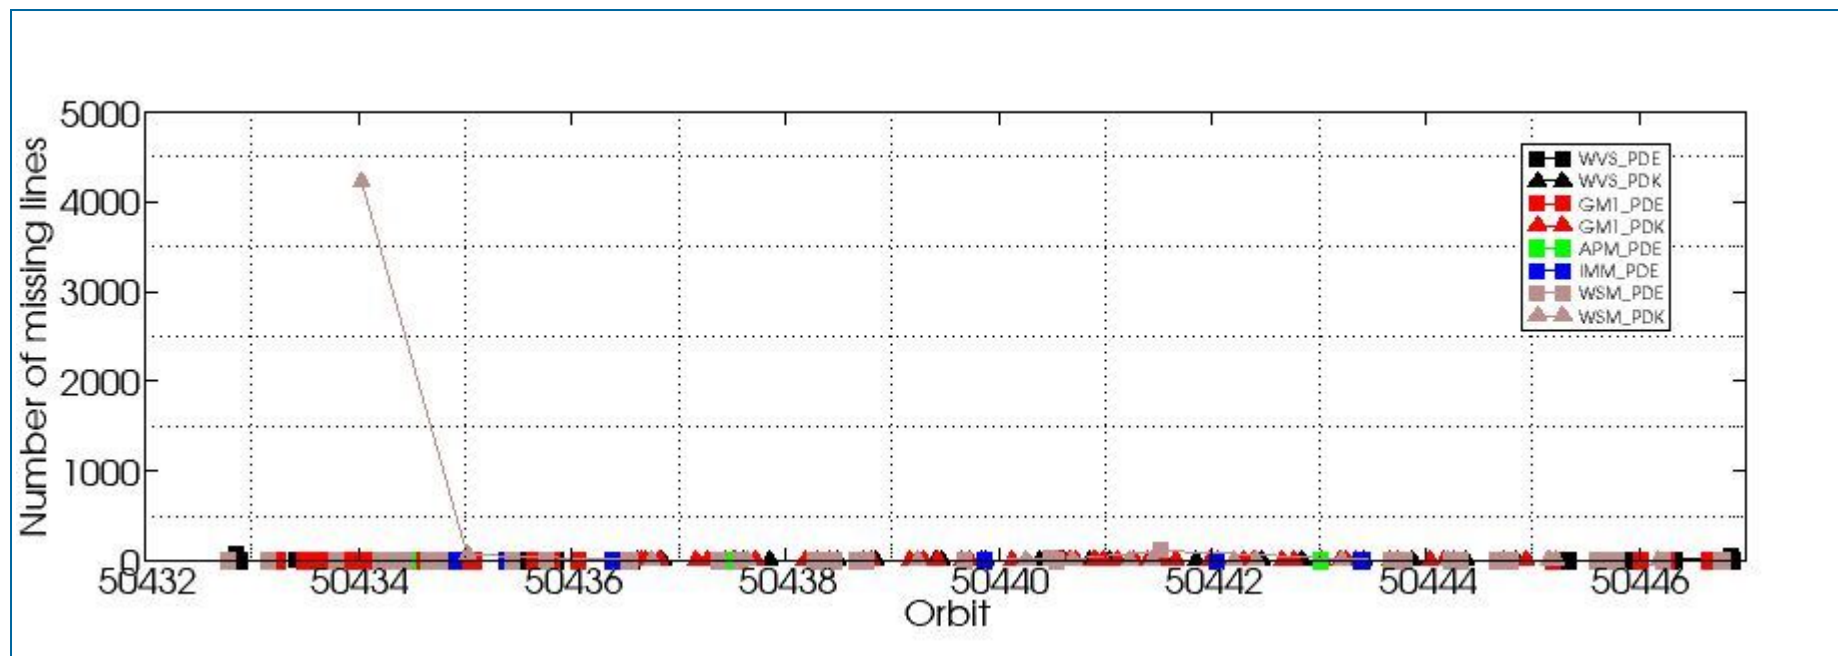

8.2 - Number of Gaps

[[BACK TO MENU](#)]

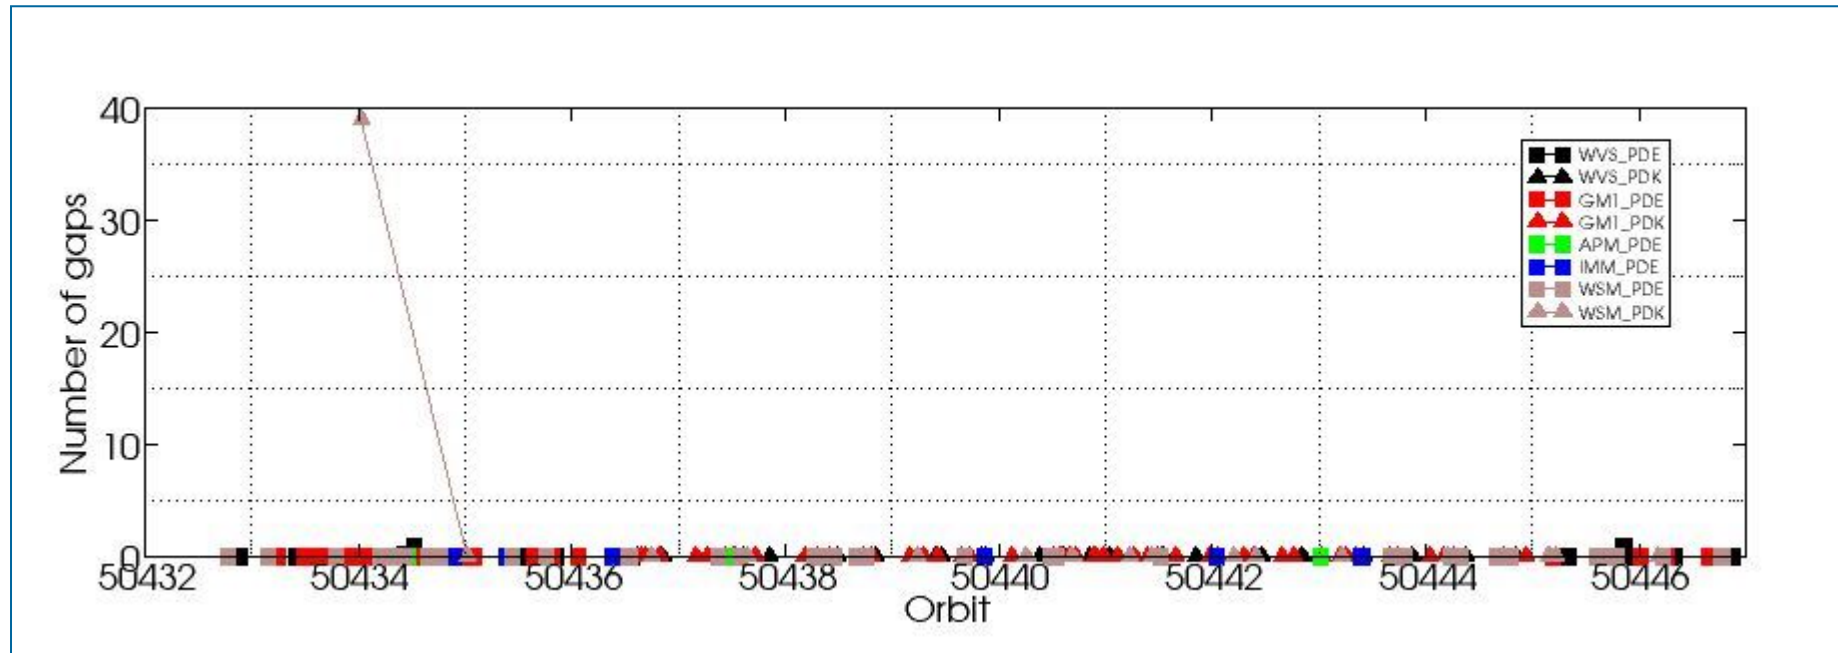

ASAR DAILY REPORT for 111022
#####

MODE: DAILY
ANALYSIS: ALL
DATE: 2011-10-22 00:00:00

Analysis will be performed from 2011-10-22 00:00:00 to 2011-10-22 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_111022/

DATA SUMMARY

Summary will be performed from 2011-10-22 00:00:00 to 2011-10-22 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_111022/DATA_SUMMARY

Creating directory ./RESULTS/DAILY/_111022/DATA_SUMMARY...
Writing file ./RESULTS/DAILY/_111022/DATA_SUMMARY/Data_summary.html...

Getting WVS products list from 2011-10-22 00:00:00 to 2011-10-22 23:59:59...
Writing file ./RESULTS/DAILY/_111022/DATA_SUMMARY/List_WVS_products_used.xls...
Writing file ./RESULTS/DAILY/_111022/DATA_SUMMARY/List_WVS_products_used.txt...

Getting GM1 products list from 2011-10-22 00:00:00 to 2011-10-22 23:59:59...
Writing file ./RESULTS/DAILY/_111022/DATA_SUMMARY/List_GM1_products_used.xls...
Writing file ./RESULTS/DAILY/_111022/DATA_SUMMARY/List_GM1_products_used.txt...

Getting APM products list from 2011-10-22 00:00:00 to 2011-10-22 23:59:59...
Writing file ./RESULTS/DAILY/_111022/DATA_SUMMARY/List_APM_products_used.xls...
Writing file ./RESULTS/DAILY/_111022/DATA_SUMMARY/List_APM_products_used.txt...

Getting IMM products list from 2011-10-22 00:00:00 to 2011-10-22 23:59:59...
Writing file ./RESULTS/DAILY/_111022/DATA_SUMMARY/List_IMM_products_used.xls...
Writing file ./RESULTS/DAILY/_111022/DATA_SUMMARY/List_IMM_products_used.txt...

Getting WSM products list from 2011-10-22 00:00:00 to 2011-10-22 23:59:59...
Writing file ./RESULTS/DAILY/_111022/DATA_SUMMARY/List_WSM_products_used.xls...
Writing file ./RESULTS/DAILY/_111022/DATA_SUMMARY/List_WSM_products_used.txt...

Getting MS products list from 2011-10-22 00:00:00 to 2011-10-22 23:59:59...
Writing file ./RESULTS/DAILY/_111022/DATA_SUMMARY/List_MS_products_used.xls...
Writing file ./RESULTS/DAILY/_111022/DATA_SUMMARY/List_MS_products_used.txt...

DATA SUMMARY completed
#####

AUXILIARY FILES ANALYSIS

Analysis will be performed from 2011-10-22 00:00:00 to 2011-10-22 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_111022/AUXILIARY

Creating directory ./RESULTS/DAILY/_111022/AUXILIARY...

Looking for the IECF operational ADFs list...



ADF filter 20111022*current_3_IECF_ADFs.txt
 Found list 20111022_030001_current_3_IECF_ADFs.txt...
 Extracting ADFs...

ASA_CON_AXVIEC20110526_075001_20101027_215740_20141231_000000
 ASA_INS_AXVIEC20110124_114858_20101228_112000_20141231_235959
 ASA_XCH_AXVIEC20101222_143057_20020301_000000_20141231_000000
 ASA_XCA_AXVIEC20110526_075734_20101027_215740_20141231_000000

Writing file ./RESULTS/DAILY/_111022/AUXILIARY/ASAR_ADFs_IECF_List3.html...
 Writing file ./RESULTS/DAILY/_111022/AUXILIARY/Auxiliary_files_summary.html...

Analysing WVS products...

Writing file ./RESULTS/DAILY/_111022/AUXILIARY/Check_ADFs_WVS.xls...
 Writing file ./RESULTS/DAILY/_111022/AUXILIARY/Check_ADFs_WVS.txt...

ASA_WVS_1PNPDE20111022_000551_000002703107_00418_50432_1274.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_000936_000015593107_00418_50432_1309.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_010214_000004873107_00419_50433_1302.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_012112_000002853107_00419_50433_1301.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_014552_000000893107_00419_50433_1308.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_014622_000003453107_00419_50433_1333.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_014622_000003453107_00419_50433_1342.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_025321_000004793107_00420_50434_1334.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_030106_000003003107_00420_50434_1363.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_032546_000000603107_00420_50434_1361.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_033328_000001493107_00420_50434_1366.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_034146_000000743107_00421_50435_1370.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_034146_000000743107_00421_50435_1375.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_043051_000007353107_00421_50435_1369.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_043051_000007353107_00421_50435_1374.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_044236_000000903107_00421_50435_1404.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_050609_000012893107_00421_50435_1416.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_060641_000004943107_00422_50436_1415.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_061909_000002103107_00422_50436_1418.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_205747_000015293107_00431_50445_1574.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_212614_000001503107_00431_50445_1570.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_214930_000001803107_00431_50445_1577.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_215145_000007793107_00431_50445_1581.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_223650_000019343108_00001_50446_1593.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_232909_000002103108_00001_50446_1589.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20111022_233154_000014093108_00001_50446_1627.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_062209_000002703107_00422_50436_4607.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_064623_000018743107_00422_50436_4610.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_080225_000002103107_00423_50437_4646.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_082637_000019643107_00423_50437_4649.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_093130_000009443107_00424_50438_4679.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_100651_000018443107_00424_50438_4682.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_110255_000000593107_00425_50439_4707.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_110916_000010793107_00425_50439_4710.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_114705_000001053107_00425_50439_4711.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_115020_000013793107_00425_50439_4713.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_115020_000013793107_00425_50439_4715.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_124015_000005843107_00426_50440_4739.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_130402_000002103107_00426_50440_4746.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_132719_000002103107_00426_50440_4747.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_134641_000003413107_00427_50441_4751.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_143754_000006003107_00427_50441_4773.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_150733_000007353107_00427_50441_4776.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_160909_000011393107_00428_50442_4805.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_164747_000010043107_00428_50442_4807.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_174513_000013793107_00429_50443_4835.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_183057_000009593107_00429_50443_4837.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20111022_192033_000016793107_00430_50444_4855.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK



ASA_WVS_1PNPDK20111022_200806_000004653107_00430_50444_4860.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_WVS_1PNPDK20111022_200806_000004653107_00430_50444_4861.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing GM1 products...

Writing file ./RESULTS/DAILY/_111022/AUXILIARY/Check_ADFs_GM1.xls...

Writing file ./RESULTS/DAILY/_111022/AUXILIARY/Check_ADFs_GM1.txt...

ASA_GM1_1PNPDE20111022_004558_000009733107_00419_50433_1307.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_011102_000001873107_00419_50433_1306.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_011511_000003563107_00419_50433_1305.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_012642_000007553107_00419_50433_1304.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_015247_000006283107_00419_50433_1328.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_020736_000008703107_00420_50434_1330.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_022542_000001443107_00420_50434_1331.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_023145_000007853107_00420_50434_1332.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_025039_000001573107_00420_50434_1335.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_031053_000004343107_00420_50434_1364.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_032724_000002113107_00420_50434_1362.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_033200_000000783107_00420_50434_1365.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_033641_000003023107_00420_50434_1367.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_035020_000017703107_00421_50435_1372.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_035020_000017703107_00421_50435_1377.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_042410_000001203107_00421_50435_1371.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_042410_000001203107_00421_50435_1376.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_044710_000000783107_00421_50435_1403.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_044955_000004343107_00421_50435_1405.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_050347_000001383107_00421_50435_1407.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_052829_000018313107_00422_50436_1417.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_060454_000001023107_00422_50436_1414.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_204312_000001383107_00431_50445_1565.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_212929_000000663107_00431_50445_1572.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_213435_000005013107_00431_50445_1571.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_220531_000005793108_00001_50446_1579.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_222946_000004223108_00001_50446_1584.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_230944_000000783108_00001_50446_1583.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDE20111022_231228_000005373108_00001_50446_1595.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_062724_000000783107_00422_50436_4606.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_063009_000003203107_00422_50436_4608.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_064413_000001263107_00422_50436_4609.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_071827_000007013107_00423_50437_4611.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_072900_000006283107_00423_50437_4641.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_074511_000003803107_00423_50437_4643.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_075230_000001383107_00423_50437_4642.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_075556_000001753107_00423_50437_4644.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_081331_000007853107_00423_50437_4647.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_090005_000005373107_00424_50438_4648.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_091140_000000843107_00424_50438_4650.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_091216_000001753107_00424_50438_4677.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_092313_000002773107_00424_50438_4678.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_095556_000001813107_00424_50438_4680.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_100324_000002053107_00424_50438_4681.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_103815_000004773107_00425_50439_4683.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_105122_000001143107_00425_50439_4706.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_110441_000002713107_00425_50439_4708.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_112808_000001263107_00425_50439_4709.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_113442_000007433107_00425_50439_4712.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_121411_000008463107_00426_50440_4714.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_121411_000008463107_00426_50440_4716.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_125312_000001753107_00426_50440_4741.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_130025_000000963107_00426_50440_4740.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_130214_000001023107_00426_50440_4742.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_130820_000001993107_00426_50440_4743.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_131508_000007313107_00426_50440_4745.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
 ASA_GM1_1PNPDK20111022_133137_000001023107_00426_50440_4744.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

ASA_GM1_1PNPDK20111022_133329_000003503107_00426_50440_4748.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_134019_000003803107_00426_50440_4749.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_135414_000006283107_00427_50441_4750.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_140959_000002713107_00427_50441_4769.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_142212_000002353107_00427_50441_4770.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_143048_000002053107_00427_50441_4771.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_143554_000001143107_00427_50441_4772.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_144833_000011363107_00427_50441_4775.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_152034_000002833107_00427_50441_4774.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_152825_000008883107_00428_50442_4777.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_155148_000001873107_00428_50442_4802.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_160210_000001203107_00428_50442_4803.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_162844_000001323107_00428_50442_4804.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_163922_000005013107_00428_50442_4806.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_170614_000010573107_00429_50443_4808.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_172239_000001323107_00429_50443_4830.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_172911_000001873107_00429_50443_4832.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_173741_000002413107_00429_50443_4833.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_180904_000001203107_00429_50443_4834.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_181744_000003263107_00429_50443_4836.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_184736_000008103107_00430_50444_4838.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_185951_000002773107_00430_50444_4853.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_191036_000002233107_00430_50444_4854.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_195705_000003143107_00430_50444_4857.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20111022_201639_000012993107_00430_50444_4859.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing APM products...

Writing file ./RESULTS/DAILY/_111022/AUXILIARY/Check_ADFs_APM.xls...

Writing file ./RESULTS/DAILY/_111022/AUXILIARY/Check_ADFs_APM.txt...

ASA_APM_1PNPDE20111022_024743_00000873107_00420_50434_1325.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20111022_075130_00000443107_00423_50437_1442.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20111022_075454_00000443107_00423_50437_1446.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20111022_092212_00000433107_00424_50438_1471.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20111022_152722_00000423107_00428_50442_1538.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20111022_170511_00000443107_00429_50443_1544.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing IMM products...

Writing file ./RESULTS/DAILY/_111022/AUXILIARY/Check_ADFs_IMM.xls...

Writing file ./RESULTS/DAILY/_111022/AUXILIARY/Check_ADFs_IMM.txt...

ASA_IMM_1PNPDE20111022_033056_00000523107_00420_50434_1358.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20111022_041951_000002433107_00421_50435_1359.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20111022_055902_000003393107_00422_50436_1402.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20111022_091954_00000693107_00424_50438_1468.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20111022_114922_00000523107_00425_50439_1520.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20111022_152636_00000373107_00428_50442_1539.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20111022_174140_000001123107_00429_50443_1555.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20111022_174351_00000423107_00429_50443_1554.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing WSM products...

Writing file ./RESULTS/DAILY/_111022/AUXILIARY/Check_ADFs_WSM.xls...

Writing file ./RESULTS/DAILY/_111022/AUXILIARY/Check_ADFs_WSM.txt...

ASA_WSM_1PNPDE20111022_003623_000005693107_00419_50433_1298.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_003623_000005693107_00419_50433_1299.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

ASA_WSM_1PNPDE20111022_003623_000005693107_00419_50433_1303.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_013920_000003923107_00419_50433_1297.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_022209_000002143107_00420_50434_1327.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_022809_000002143107_00420_50434_1329.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_024453_000001593107_00420_50434_1326.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_030719_000002083107_00420_50434_1341.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_031811_000003923107_00420_50434_1357.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_042616_000002753107_00421_50435_1360.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_045713_000003923107_00421_50435_1401.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_061531_000002083107_00422_50436_1406.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_073939_000003303107_00423_50437_1443.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_075855_000002083107_00423_50437_1447.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_090904_000001533107_00424_50438_1464.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_091513_000002203107_00424_50438_1467.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_092755_000002143107_00424_50438_1472.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_094857_000004163107_00424_50438_1505.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_095859_000002513107_00424_50438_1506.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_113020_000002513107_00425_50439_1507.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_125041_000001103107_00426_50440_1527.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_125613_000002453107_00426_50440_1528.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_143448_000000613107_00427_50441_1536.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_181110_000003733107_00429_50443_1556.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_182314_000001903107_00429_50443_1553.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_190626_000002453107_00430_50444_1560.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_191646_000001533107_00430_50444_1563.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_195028_000003923107_00430_50444_1564.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_200220_000003303107_00430_50444_1562.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_212355_000000923107_00431_50445_1580.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_213046_000002263107_00431_50445_1585.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_214259_000003923107_00431_50445_1566.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_222612_000002083108_00001_50446_1586.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_222612_000002083108_00001_50446_1588.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20111022_232130_000004593108_00001_50446_1582.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_020326_000002453107_00420_50434_4572.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_034345_000003923107_00421_50435_4588.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_063533_000005143107_00422_50436_4624.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_080638_000004103107_00423_50437_4657.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_104614_000003003107_00425_50439_4688.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_122821_000004533107_00426_50440_4727.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_131143_000001903107_00426_50440_4760.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_140447_000003123107_00427_50441_4759.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_142613_000002693107_00427_50441_4768.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_154319_000004893107_00428_50442_4789.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_160418_000002693107_00428_50442_4796.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_172458_000002513107_00429_50443_4816.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_190429_000001533107_00430_50444_4844.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_203820_000000923107_00431_50445_4858.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_204052_000001353107_00431_50445_4867.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_204536_000001843107_00431_50445_4869.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20111022_222212_000002083108_00001_50446_4885.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

AUXILIARY FILES ANALYSIS completed

#####

MODULE STEPPING ANALYSIS

#####

Analysis will be performed from 2011-10-22 00:00:00 to 2011-10-22 23:59:59

Results will be exported to the directory: ./RESULTS/DAILY/_111022/MODULE_STEPPING

Creating directory ./RESULTS/DAILY/_111022/MODULE_STEPPING...

Creating directory ./RESULTS/DAILY/_111022/MODULE_STEPPING/FIRST_REFERENCE...

Creating directory ./RESULTS/DAILY/_111022/MODULE_STEPPING/SECOND_REFERENCE...

Creating directory ./RESULTS/DAILY/_111022/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Deleting old files...

Creating images comparing with second reference...

Exporting results to the directory ../../RESULTS/DAILY/_111022/MODULE_STEPPING/SECOND_REFERENCE...

Polarization: H
Reference product: ASA_MS__0PNPK20010209_135042_0000009A024_00180_11700_0052.N1
Test product: ASA_MS__0PNPDE20111022_231110_000000163108_00001_50446_0406.N1
H
H
../../RESULTS/DAILY/_111022/MODULE_STEPPING/SECOND_REFERENCE/TGH_20111022_231110-20010209_135042.png
../../RESULTS/DAILY/_111022/MODULE_STEPPING/SECOND_REFERENCE/TPH_20111022_231110-20010209_135042.png
../../RESULTS/DAILY/_111022/MODULE_STEPPING/SECOND_REFERENCE/RGH_20111022_231110-20010209_135042.png
../../RESULTS/DAILY/_111022/MODULE_STEPPING/SECOND_REFERENCE/RPH_20111022_231110-20010209_135042.png

Polarization: V
Reference product: ASA_MS__0PNPK20010209_140823_0000009A024_00180_11700_0054.N1
Test product: ASA_MS__0PNPK20111022_062851_000000163107_00422_50436_0846.N1
V
V
../../RESULTS/DAILY/_111022/MODULE_STEPPING/SECOND_REFERENCE/TGV_20111022_062851-20010209_140823.png
../../RESULTS/DAILY/_111022/MODULE_STEPPING/SECOND_REFERENCE/TPV_20111022_062851-20010209_140823.png
../../RESULTS/DAILY/_111022/MODULE_STEPPING/SECOND_REFERENCE/RGV_20111022_062851-20010209_140823.png
../../RESULTS/DAILY/_111022/MODULE_STEPPING/SECOND_REFERENCE/RPV_20111022_062851-20010209_140823.png

Creating images comparing with previous product reference...

Exporting results to the directory ../../RESULTS/DAILY/_111022/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Polarization: H
Reference product: ASA_MS__0PNPDE20111022_044837_000000163107_00421_50435_0405.N1
Test product: ASA_MS__0PNPDE20111022_231110_000000163108_00001_50446_0406.N1
H
H
../../RESULTS/DAILY/_111022/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGH_20111022_231110-20111022_044837.png
../../RESULTS/DAILY/_111022/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPH_20111022_231110-20111022_044837.png
../../RESULTS/DAILY/_111022/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGH_20111022_231110-20111022_044837.png
../../RESULTS/DAILY/_111022/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPH_20111022_231110-20111022_044837.png

Polarization: V
Reference product: ASA_MS__0PNPK20111021_070536_000000163107_00408_50422_0845.N1
Test product: ASA_MS__0PNPK20111022_062851_000000163107_00422_50436_0846.N1
V
V
../../RESULTS/DAILY/_111022/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGV_20111022_062851-20111021_070536.png
../../RESULTS/DAILY/_111022/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPV_20111022_062851-20111021_070536.png
../../RESULTS/DAILY/_111022/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGV_20111022_062851-20111021_070536.png
../../RESULTS/DAILY/_111022/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPV_20111022_062851-20111021_070536.png

MODULE_STEPPING ANALYSIS completed
#####

CALIBRATION PULSES ANALYSIS

Creating directory ./RESULTS/DAILY/_111022/CALIBRATION_PULSES...

ALL ROWS Analysis will be performed from 2011-10-22 00:00:00 to 2011-10-22 23:59:59

```
Analysing products WVS IS2 V/V
  1      76320      7      76320
Writing image ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Calibration_pulses_all_rows_WVS_IS2_VV.png...
Analysing products GM1 SS3 H/H
  1      45984      7      45984
Writing image ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Calibration_pulses_all_rows_GM1_SS3_HH.png...
```

```
*****
*****
TEMPORAL EVOLUTION Analysis will be performed from 2011-10-22 00:00:00 to 2011-10-22 23:59:59
```

```
Analysing products WVS IS2 V/V
Getting calibration pulses data for WVS IS2 V/V from 2011-10-22 00:00:00 to 2011-10-22 23:59:59. Rows: 1/5/9/13/17/21/25/29
Writing file ./RESULTS/DAILY/_111022/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2011-10-22_1.dat...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_1.png...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_1.png...
```

```
Getting calibration pulses data for WVS IS2 V/V from 2011-10-22 00:00:00 to 2011-10-22 23:59:59. Rows: 2/6/10/14/18/22/26/30
Writing file ./RESULTS/DAILY/_111022/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2011-10-22_2.dat...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_2.png...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_2.png...
```

```
Getting calibration pulses data for WVS IS2 V/V from 2011-10-22 00:00:00 to 2011-10-22 23:59:59. Rows: 3/7/11/15/19/23/27/31
Writing file ./RESULTS/DAILY/_111022/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2011-10-22_3.dat...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_3.png...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_3.png...
```

```
Getting calibration pulses data for WVS IS2 V/V from 2011-10-22 00:00:00 to 2011-10-22 23:59:59. Rows: 4/8/12/16/20/24/28/32
Writing file ./RESULTS/DAILY/_111022/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2011-10-22_4.dat...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_4.png...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_4.png...
```

```
Analysing products GM1 SS3 H/H
Getting calibration pulses data for GM1 SS3 H/H from 2011-10-22 00:00:00 to 2011-10-22 23:59:59. Rows: 1/5/9/13/17/21/25/29
Writing file ./RESULTS/DAILY/_111022/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2011-10-22_1.dat...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_1.png...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_1.png...
```

```
Getting calibration pulses data for GM1 SS3 H/H from 2011-10-22 00:00:00 to 2011-10-22 23:59:59. Rows: 2/6/10/14/18/22/26/30
Writing file ./RESULTS/DAILY/_111022/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2011-10-22_2.dat...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_2.png...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_2.png...
```

```
Getting calibration pulses data for GM1 SS3 H/H from 2011-10-22 00:00:00 to 2011-10-22 23:59:59. Rows: 3/7/11/15/19/23/27/31
Writing file ./RESULTS/DAILY/_111022/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2011-10-22_3.dat...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_3.png...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_3.png...
```

```
Getting calibration pulses data for GM1 SS3 H/H from 2011-10-22 00:00:00 to 2011-10-22 23:59:59. Rows: 4/8/12/16/20/24/28/32
Writing file ./RESULTS/DAILY/_111022/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2011-10-22_4.dat...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_4.png...
Writing ../../RESULTS/DAILY/_111022//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_4.png...
```

```
CALIBRATION PULSES ANALYSIS completed
#####
```

DOPPLER ANALYSIS

#####

Creating directory ./RESULTS/DAILY/_111022/DOPPLER...

DOPPLER ANX Analysis will be performed from 2011-10-22 00:00:00 to 2011-10-22 23:59:59

Analysing products WVS IS2 V/V

Getting doppler data for WVS IS2 V/V from 2011-10-22 00:00:00 to 2011-10-22 23:59:59...

Writing file ./RESULTS/DAILY/_111022/DOPPLER/Doppler_data_WVS_IS2_VV_2011-10-22.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/_111022/DOPPLER/DOPPLER_ANX_WVS_IS2_VV.png...

Analysing products GM1 SS1 H/H

Getting doppler data for GM1 SS1 H/H from 2011-10-22 00:00:00 to 2011-10-22 23:59:59...

Writing file ./RESULTS/DAILY/_111022/DOPPLER/Doppler_data_GM1_SS1_HH_2011-10-22.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/_111022/DOPPLER/DOPPLER_ANX_GM1_SS1_HH.png...

DOPPLER JUMPS Analysis will be performed on WSM products from 2011-10-22 00:00:00 to 2011-10-22 23:59:59

Analysing by default products WSM

Getting doppler jumps data for WSM from 2011-10-22 00:00:00 to 2011-10-22 23:59:59...

Writing file ./RESULTS/DAILY/_111022/DOPPLER/Doppler_Jumps_data_WSM_2011-10-22.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/_111022/DOPPLER/DOPPLER_JUMPS_ANX_WSM.png...

Writing file ../../RESULTS/DAILY/_111022/DOPPLER/DOPPLER_JUMPS_Date_WSM.png...

DOPPLER MAP Analysis will be performed from 2011-10-22 00:00:00 to 2011-10-22 23:59:59

Analysing products WVS IS2 V/V

mysql -h172.26.16.25 -ucbts_WV -pcbts_WV -e "SELECT Glon,Glat,D0,ANX FROM file,Dop WHERE Product='WVS' AND Beam='IS2' AND Pol='V/V' AND file.FileId=Dop.FileId AND ZDopTime BETWEEN '2011-10-22 00:00:00' AND '2011-10-22 23:59:59' AND (ANX BETWEEN '1500' AND '4500');" cbts_WV

```
1
131
1      131      7      131
1      130      7      130
1058
```

Loading predicted doppler values....

./PREDICTED_DOPPLER/doppler.WV_2

87.7758
10.5846
-66.5771
-142.520
-216.086
-286.172
-351.735
-411.816
-465.557
-512.209
-551.146
-581.874
-604.040
-617.434
-621.993
-617.804
-605.099
-584.252
-555.770

-520.289
-478.560
-431.434
-379.856
-324.838
-267.455
-208.814
-150.050
-92.2908
-36.6568
15.7690
63.9616
106.958
143.888
173.973
196.555
211.098
217.196
214.587
203.150
182.918
154.068
116.919
71.9387
19.7218
-39.0043
-103.408
-172.552
-245.410
-320.887
-397.839
-475.084
-551.423
-625.659
-696.616
-763.167
-824.227
-878.795
-925.960
-964.912
-994.961
-1015.54
-1026.24
-1026.75
-1016.96
-996.863
-966.640
-926.597
-877.190
-819.014
-752.784
-679.341
-599.625
-514.669
-425.588
-333.549
-239.763
-145.472
-51.9192
39.6591
128.055
212.107
290.720
362.878
427.653
484.231
531.914
570.135

598.464
616.615
624.452
621.987
609.384
586.949
555.141
514.541
465.868
409.943
347.705
280.167
208.420
133.607
87.7758

Phase: descending

Found data...

Computing mean error doppler estimated-predicted...

Mean error = -36.065454 Hz

Writing file ../../RESULTS/DAILY/_111022//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_desc.jpg...

Writing file ../../RESULTS/DAILY/_111022//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_desc.jpg...

mysql -h172.26.16.25 -ucbts_WV -pcbts_WV -e "SELECT Glon,Glat,D0,ANX FROM file,Dop WHERE Product='WVS' AND Beam='IS2' AND Pol='V/V' AND file.FileId=Dop.FileId AND ZDopTime BETWEEN '2011-10-22 00:00:00' AND '2011-10-22 23:59:59' AND ((ANX BETWEEN '0' AND '1500') or (ANX BETWEEN '4500' AND '6500'));" cbts_WV

1			
111			
1	111	7	111
1	110	7	110
1329			

Loading predicted doppler values....

./PREDICTED_DOPPLER/doppler.WV_2

87.7758
10.5846
-66.5771
-142.520
-216.086
-286.172
-351.735
-411.816
-465.557
-512.209
-551.146
-581.874
-604.040
-617.434
-621.993
-617.804
-605.099
-584.252
-555.770
-520.289
-478.560
-431.434
-379.856
-324.838
-267.455
-208.814
-150.050
-92.2908
-36.6568
15.7690
63.9616
106.958
143.888
173.973
196.555
211.098

217.196
214.587
203.150
182.918
154.068
116.919
71.9387
19.7218
-39.0043
-103.408
-172.552
-245.410
-320.887
-397.839
-475.084
-551.423
-625.659
-696.616
-763.167
-824.227
-878.795
-925.960
-964.912
-994.961
-1015.54
-1026.24
-1026.75
-1016.96
-996.863
-966.640
-926.597
-877.190
-819.014
-752.784
-679.341
-599.625
-514.669
-425.588
-333.549
-239.763
-145.472
-51.9192
39.6591
128.055
212.107
290.720
362.878
427.653
484.231
531.914
570.135
598.464
616.615
624.452
621.987
609.384
586.949
555.141
514.541
465.868
409.943
347.705
280.167
208.420
133.607
87.7758

Phase: ascending
Found data...



Computing mean error doppler estimated-predicted...
 Mean error = -29.170828 Hz
 Writing file ../../RESULTS/DAILY/_111022//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_asc.jpg...
 Writing file ../../RESULTS/DAILY/_111022//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_asc.jpg...

Analysing products GM1 SS1 H/H

mysql -h172.26.16.25 -ucbts_GM -pcbts_GM -e "SELECT Glon,Glat,D0,ANX FROM file,Dop WHERE Product='GM1' AND Beam='SS1' AND Pol='H/H' AND file.FileId=Dop.FileId AND ZDopTime BETWEEN '2011-10-22 00:00:00' AND '2011-10-22 23:59:59' AND (ANX BETWEEN '1500' AND '4500');" cbtns_GM

```

1
149
1      149      7      149
1      148      7      148
2463

```

Loading predicted doppler values....

./PREDICTED_DOPPLER/doppler.GM_1

216.826
 136.479
 56.1549
 -22.9067
 -99.5006
 -172.474
 -240.743
 -303.307
 -359.271
 -407.856
 -448.408
 -480.415
 -503.506
 -517.465
 -522.225
 -517.876
 -504.660
 -482.966
 -453.319
 -416.384
 -372.939
 -323.868
 -270.156
 -212.854
 -153.080
 -91.9846
 -30.7489
 29.4535
 87.4579
 142.137
 192.422
 237.312
 275.898
 307.370
 331.039
 346.345
 352.861
 350.313
 338.571
 317.665
 287.775
 249.231
 202.516
 148.246
 87.1750
 20.1678
 -51.8021
 -127.666
 -206.286
 -286.470

-366.984
-446.581
-524.012
-598.050
-667.520
-731.288
-788.309
-837.633
-878.414
-909.930
-931.592
-942.955
-943.721
-933.748
-913.049
-881.794
-840.306
-789.059
-728.670
-659.882
-583.571
-500.712
-412.383
-319.741
-224.000
-126.420
-28.2956
69.0819
164.424
256.474
344.022
425.926
501.129
568.661
627.675
677.441
717.367
747.001
766.044
774.352
771.933
758.957
735.740
702.757
660.611
610.049
551.927
487.220
416.983
342.352
264.518
216.826

Phase: descending

Found data...

Computing mean error doppler estimated-predicted...

Mean error = -16.990968 Hz

Writing file ../../RESULTS/DAILY/_111022//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_desc.jpg...

Writing file ../../RESULTS/DAILY/_111022//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_desc.jpg...

```
mysql -h172.26.16.25 -ucbts_GM -pcbts_GM -e "SELECT Glon,Glat,D0,ANX FROM file,Dop WHERE Product='GM1' AND Beam='SS1' AND Pol='H/H' AND file.FileId=Dop.FileId AND ZDopTime BETWEEN '2011-10-22 00:00:00' AND '2011-10-22 23:59:59' AND ((ANX BETWEEN '0' AND '1500' ) or (ANX BETWEEN '4500' AND '6500' ));" cbtns_GM
```

```
1
121
1      121      7      121
1      120      7      120
3272
```

Loading predicted doppler values....

./PREDICTED_DOPPLER/doppler.GM_1

216.826
136.479
56.1549
-22.9067
-99.5006
-172.474
-240.743
-303.307
-359.271
-407.856
-448.408
-480.415
-503.506
-517.465
-522.225
-517.876
-504.660
-482.966
-453.319
-416.384
-372.939
-323.868
-270.156
-212.854
-153.080
-91.9846
-30.7489
29.4535
87.4579
142.137
192.422
237.312
275.898
307.370
331.039
346.345
352.861
350.313
338.571
317.665
287.775
249.231
202.516
148.246
87.1750
20.1678
-51.8021
-127.666
-206.286
-286.470
-366.984
-446.581
-524.012
-598.050
-667.520
-731.288
-788.309
-837.633
-878.414
-909.930
-931.592
-942.955
-943.721
-933.748
-913.049
-881.794
-840.306

-789.059
-728.670
-659.882
-583.571
-500.712
-412.383
-319.741
-224.000
-126.420
-28.2956
69.0819
164.424
256.474
344.022
425.926
501.129
568.661
627.675
677.441
717.367
747.001
766.044
774.352
771.933
758.957
735.740
702.757
660.611
610.049
551.927
487.220
416.983
342.352
264.518
216.826

Phase: ascending

Found data...

Computing mean error doppler estimated-predicted...

Mean error = -26.326105 Hz

Writing file ../../RESULTS/DAILY/_111022//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_asc.jpg...

Writing file ../../RESULTS/DAILY/_111022//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_asc.jpg...

DOPPLER ANALYSIS completed

#####

CHIRP ANALYSIS

#####

Creating directory ./RESULTS/DAILY/_111022/CHIRP...

CHIRP Analysis will be performed from 2011-10-22 00:00:00 to 2011-10-22 23:59:59

Analysing products WSM SS1 H/H

Getting ScaleFactor data for WSM SS1 H/H from 2011-10-22 00:00:00 to 2011-10-22 23:59:59...

Writing file ./RESULTS/DAILY/_111022/CHIRP/ScaleFactor_data_WSM_SS1_HH_2011-10-22.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/_111022/CHIRP/ScaleFactor_ANX_WSM_SS1_HH.png...

Writing file ../../RESULTS/DAILY/_111022/CHIRP/ScaleFactor_DATE_WSM_SS1_HH.png...

Analysing products WSM SS1 V/V

```
*****
Getting ScaleFactor data for WSM SS1 V/V from 2011-10-22 00:00:00 to 2011-10-22 23:59:59...
Writing file ./RESULTS/DAILY/_111022/CHIRP/ScaleFactor_data_WSM_SS1_VV_2011-10-22.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/_111022/CHIRP/ScaleFactor_ANX_WSM_SS1_VV.png...
Writing file ../../RESULTS/DAILY/_111022/CHIRP/ScaleFactor_DATE_WSM_SS1_VV.png...
```

CHIRP ANALYSIS completed

#####

RAW DATA ANALYSIS

```
#####
Analysis will be performed from 2011-10-22 00:00:00 to 2011-10-22 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_111022/RAW_DATA
```

Creating directory ./RESULTS/DAILY/_111022/RAW_DATA...

```
*****
Getting raw data for WVS from 2011-10-22 00:00:00 to 2011-10-22 23:59:59...
Writing file ./RESULTS/DAILY/_111022/RAW_DATA/Raw_data_WVS_2011-10-22.dat...
Running IDL program to create graphs...
```

```
Creating image ../../RESULTS/DAILY/_111022/RAW_DATA/Raw_data_WVS_input_mean.png...
Creating image ../../RESULTS/DAILY/_111022/RAW_DATA/Raw_data_WVS_input_stdev.png...
Creating image ../../RESULTS/DAILY/_111022/RAW_DATA/Raw_data_WVS_gain_imbalance.png...
```

```
*****
Getting raw data for IMM from 2011-10-22 00:00:00 to 2011-10-22 23:59:59...
Writing file ./RESULTS/DAILY/_111022/RAW_DATA/Raw_data_IMM_2011-10-22.dat...
Running IDL program to create graphs...
```

```
Creating image ../../RESULTS/DAILY/_111022/RAW_DATA/Raw_data_IMM_input_mean.png...
Creating image ../../RESULTS/DAILY/_111022/RAW_DATA/Raw_data_IMM_input_stdev.png...
Creating image ../../RESULTS/DAILY/_111022/RAW_DATA/Raw_data_IMM_gain_imbalance.png...
```

RAW DATA ANALYSIS completed

#####

TELEMETRY ANALYSIS

```
#####
Analysis will be performed from 2011-10-22 00:00:00 to 2011-10-22 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_111022/TELEMETRY
```

Creating directory ./RESULTS/DAILY/_111022/TELEMETRY...

Looking for gaps and missing lines in WVS products...

```
Checking 26 products from PDE...
Found product...ASA_WVS_1PNPDE20111022_000551_000002703107_00418_50432_1274.N1 / 0 gaps / 80 missing lines
Found product...ASA_WVS_1PNPDE20111022_010214_000004873107_00419_50433_1302.N1 / 0 gaps / 8 missing lines
Found product...ASA_WVS_1PNPDE20111022_025321_000004793107_00420_50434_1334.N1 / 1 gaps / 0 missing lines
Found product...ASA_WVS_1PNPDE20111022_214930_000001803107_00431_50445_1577.N1 / 1 gaps / 0 missing lines
Found product...ASA_WVS_1PNPDE20111022_232909_000002103108_00001_50446_1589.N1 / 0 gaps / 56 missing lines
Checking 24 products from PDK...
Found product...ASA_WVS_1PNPDK20111022_134641_000003413107_00427_50441_4751.N1 / 0 gaps / 8 missing lines
Found product...ASA_WVS_1PNPDK20111022_192033_000016793107_00430_50444_4855.N1 / 0 gaps / 8 missing lines
```

Looking for gaps and missing lines in GM1 products...

Checking 29 products from PDE...
Checking 53 products from PDK...

Looking for gaps and missing lines in APM products...

Checking 6 products from PDE...
No products from PDK...

Looking for gaps and missing lines in IMM products...

Checking 8 products from PDE...
No products from PDK...

Looking for gaps and missing lines in WSM products...

Checking 36 products from PDE...

Found product...ASA_WSM_1PNPDE20111022_125041_000001103107_00426_50440_1527.N1 / 0 gaps / 30 missing lines

Found product...ASA_WSM_1PNPDE20111022_143448_00000613107_00427_50441_1536.N1 / 0 gaps / 121 missing lines

Checking 17 products from PDK...

Found product...ASA_WSM_1PNPDK20111022_020326_000002453107_00420_50434_4572.N1 / 39 gaps / 4234 missing lines

Found product...ASA_WSM_1PNPDK20111022_034345_000003923107_00421_50435_4588.N1 / 0 gaps / 68 missing lines

Found product...ASA_WSM_1PNPDK20111022_160418_000002693107_00428_50442_4796.N1 / 0 gaps / 1 missing lines

Creating graph of missing lines and gaps...

Creating image: ./RESULTS/DAILY/_111022/TELEMETRY/TELEMETRY_Missing_lines.png...

Creating image: ./RESULTS/DAILY/_111022/TELEMETRY/TELEMETRY_Gaps.png...

TELEMETRY ANALYSIS completed

#####

HTML REPORT generation

#####

Building file ./RESULTS/DAILY/_111022/asarReport.html...

Building DATA SUMMARY section...

Building AUXILIARY FILES ANALYSIS section...

Building MODULE STEPPING ANALYSIS section...

Building CALIBRATION PULSES ANALYSIS section...

Building DOPPLER ANALYSIS section...

Building CHIRP ANALYSIS section...

Building RAW DATA ANALYSIS section...

Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed

#####



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20111022_024743_000000873107_00420_50434_1325.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20111022_075130_000000443107_00423_50437_1442.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20111022_075454_000000443107_00423_50437_1446.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20111022_092212_000000433107_00424_50438_1471.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20111022_152722_000000423107_00428_50442_1538.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20111022_170511_000000443107_00429_50443_1544.N1	OK	OK	OK	OK

ASA_GM1_1PNPDK20111022_144833_000011363107_00427_50441_4775.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_152034_000002833107_00427_50441_4774.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_152825_000008883107_00428_50442_4777.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_155148_000001873107_00428_50442_4802.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_160210_000001203107_00428_50442_4803.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_162844_000001323107_00428_50442_4804.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_163922_000005013107_00428_50442_4806.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_170614_000010573107_00429_50443_4808.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_172239_000001323107_00429_50443_4830.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_172911_000001873107_00429_50443_4832.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_173741_000002413107_00429_50443_4833.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_180904_000001203107_00429_50443_4834.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_181744_000003263107_00429_50443_4836.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_184736_000008103107_00430_50444_4838.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_185951_000002773107_00430_50444_4853.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_191036_000002233107_00430_50444_4854.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_195705_000003143107_00430_50444_4857.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20111022_201639_000012993107_00430_50444_4859.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_IMM_1PNPDE20111022_033056_00000523107_00420_50434_1358.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20111022_041951_000002433107_00421_50435_1359.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20111022_055902_000003393107_00422_50436_1402.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20111022_091954_00000693107_00424_50438_1468.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20111022_114922_00000523107_00425_50439_1520.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20111022_152636_00000373107_00428_50442_1539.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20111022_174140_000001123107_00429_50443_1555.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20111022_174351_00000423107_00429_50443_1554.N1	OK	OK	OK	OK


Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WSM_1PNPDE20111022_003623_000005693107_00419_50433_1298.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_003623_000005693107_00419_50433_1299.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_003623_000005693107_00419_50433_1303.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_013920_000003923107_00419_50433_1297.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_022209_000002143107_00420_50434_1327.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_022809_000002143107_00420_50434_1329.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_024453_000001593107_00420_50434_1326.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_030719_000002083107_00420_50434_1341.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_031811_000003923107_00420_50434_1357.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_042616_000002753107_00421_50435_1360.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_045713_000003923107_00421_50435_1401.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_061531_000002083107_00422_50436_1406.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_073939_000003303107_00423_50437_1443.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_075855_000002083107_00423_50437_1447.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_090904_000001533107_00424_50438_1464.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_091513_000002203107_00424_50438_1467.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_092755_000002143107_00424_50438_1472.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_094857_000004163107_00424_50438_1505.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_095859_000002513107_00424_50438_1506.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_113020_000002513107_00425_50439_1507.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_125041_000001103107_00426_50440_1527.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_125613_000002453107_00426_50440_1528.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_143448_000000613107_00427_50441_1536.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_181110_000003733107_00429_50443_1556.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_182314_000001903107_00429_50443_1553.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_190626_000002453107_00430_50444_1560.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_191646_000001533107_00430_50444_1563.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_195028_000003923107_00430_50444_1564.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_200220_000003303107_00430_50444_1562.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_212355_000000923107_00431_50445_1580.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_213046_000002263107_00431_50445_1585.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_214259_000003923107_00431_50445_1566.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_222612_000002083108_00001_50446_1586.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_222612_000002083108_00001_50446_1588.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20111022_232130_000004593108_00001_50446_1582.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_020326_000002453107_00420_50434_4572.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_034345_000003923107_00421_50435_4588.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_063533_000005143107_00422_50436_4624.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_080638_000004103107_00423_50437_4657.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_104614_000003003107_00425_50439_4688.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_122821_000004533107_00426_50440_4727.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_131143_000001903107_00426_50440_4760.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_140447_000003123107_00427_50441_4759.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_142613_000002693107_00427_50441_4768.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_154319_000004893107_00428_50442_4789.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_160418_000002693107_00428_50442_4796.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_172458_000002513107_00429_50443_4816.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_190429_000001533107_00430_50444_4844.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_203820_000000923107_00431_50445_4858.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_204052_000001353107_00431_50445_4867.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_204536_000001843107_00431_50445_4869.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20111022_222212_000002083108_00001_50446_4885.N1					OK	OK	OK	OK





Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20111022_000551_000002703107_00418_50432_1274.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_000936_000015593107_00418_50432_1309.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_010214_000004873107_00419_50433_1302.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_012112_000002853107_00419_50433_1301.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_014552_000000893107_00419_50433_1308.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_014622_000003453107_00419_50433_1333.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_014622_000003453107_00419_50433_1342.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_025321_000004793107_00420_50434_1334.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_030106_000003003107_00420_50434_1363.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_032546_000000603107_00420_50434_1361.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_033328_000001493107_00420_50434_1366.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_034146_000000743107_00421_50435_1370.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_034146_000000743107_00421_50435_1375.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_043051_000007353107_00421_50435_1369.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_043051_000007353107_00421_50435_1374.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_044236_000000903107_00421_50435_1404.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_050609_000012893107_00421_50435_1416.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_060641_000004943107_00422_50436_1415.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_061909_000002103107_00422_50436_1418.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_205747_000015293107_00431_50445_1574.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_212614_000001503107_00431_50445_1570.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_214930_000001803107_00431_50445_1577.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_215145_000007793107_00431_50445_1581.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_223650_000019343108_00001_50446_1593.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_232909_000002103108_00001_50446_1589.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20111022_233154_000014093108_00001_50446_1627.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_062209_000002703107_00422_50436_4607.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_064623_000018743107_00422_50436_4610.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_080225_000002103107_00423_50437_4646.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_082637_000019643107_00423_50437_4649.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_093130_000009443107_00424_50438_4679.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_100651_000018443107_00424_50438_4682.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_110255_000000593107_00425_50439_4707.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_110916_000010793107_00425_50439_4710.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_114705_000001053107_00425_50439_4711.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_115020_000013793107_00425_50439_4713.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_115020_000013793107_00425_50439_4715.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_124015_000005843107_00426_50440_4739.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_130402_000002103107_00426_50440_4746.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_132719_000002103107_00426_50440_4747.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_134641_000003413107_00427_50441_4751.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_143754_000006003107_00427_50441_4773.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_150733_000007353107_00427_50441_4776.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_160909_000011393107_00428_50442_4805.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_164747_000010043107_00428_50442_4807.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_174513_000013793107_00429_50443_4835.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_183057_000009593107_00429_50443_4837.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_192033_000016793107_00430_50444_4855.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_200806_000004653107_00430_50444_4860.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20111022_200806_000004653107_00430_50444_4861.N1					OK	OK	OK	OK

Calibration pulses for GM1 SS3 H/H

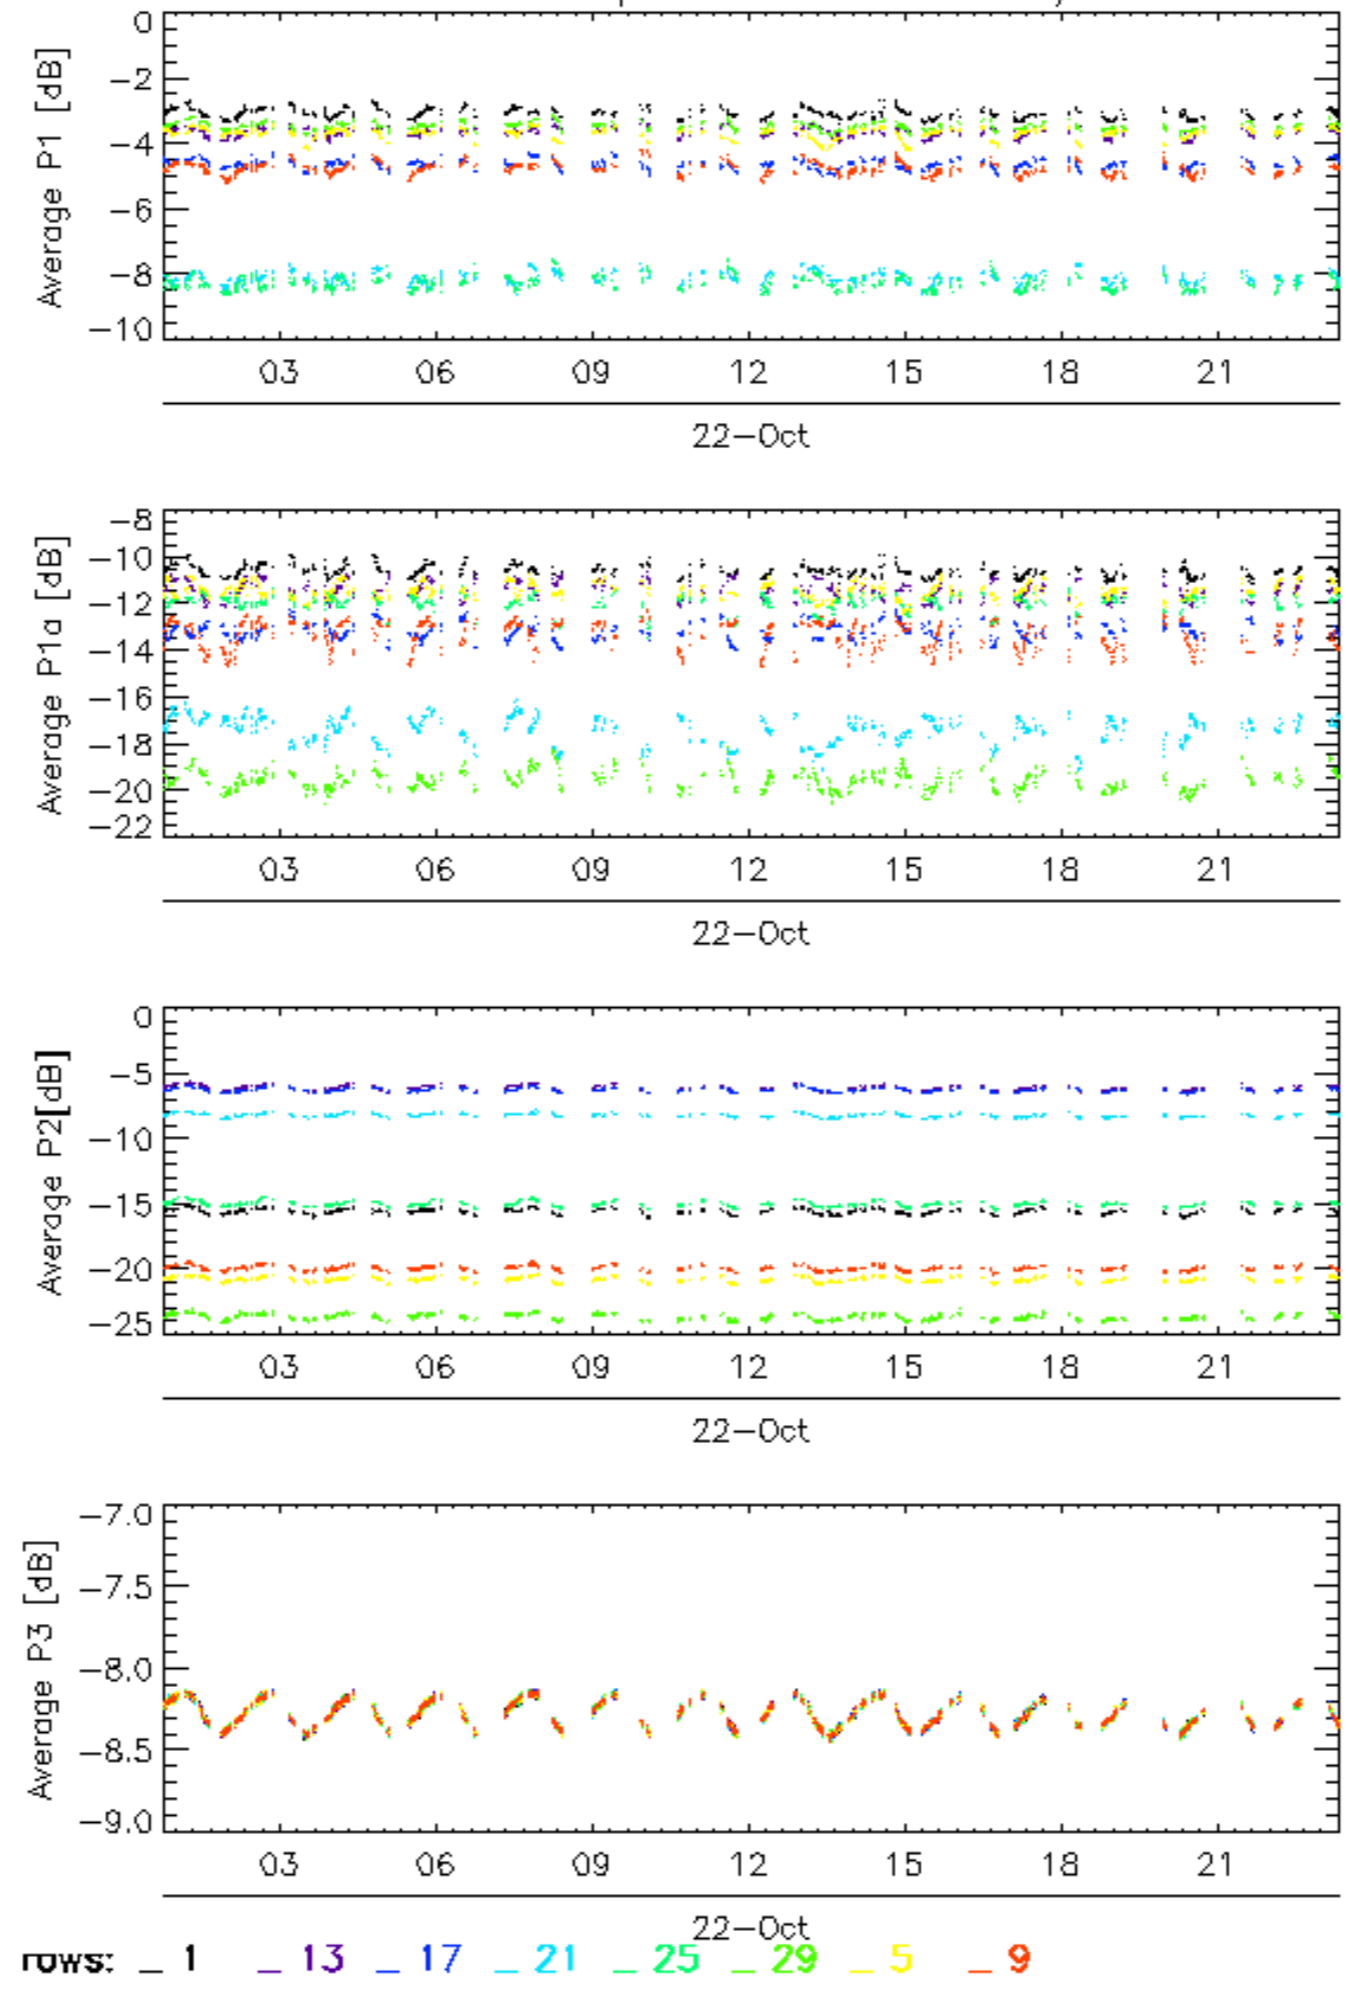


Calibration pulses for GM1 SS3 H/H

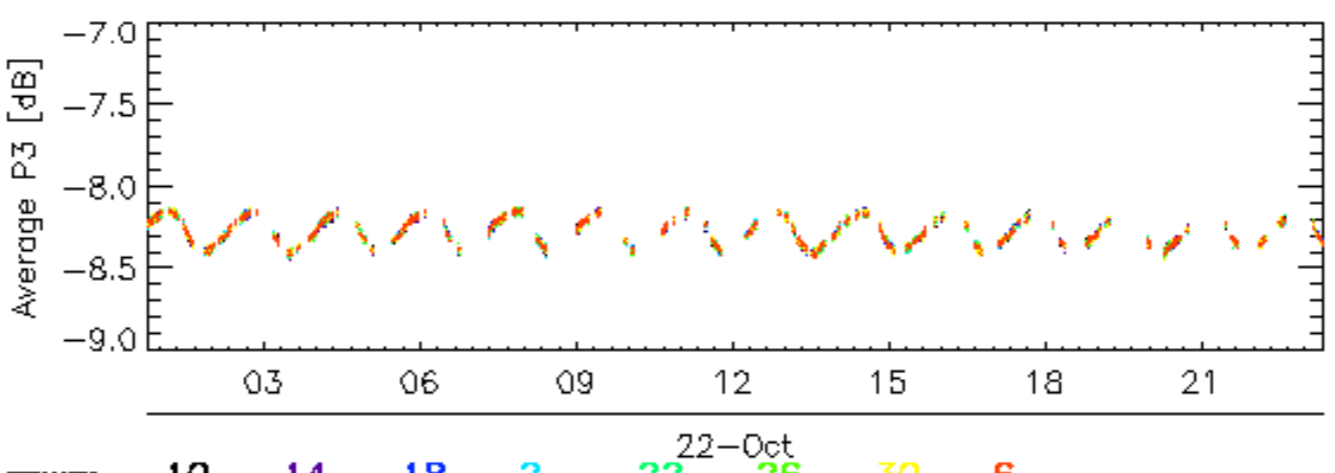
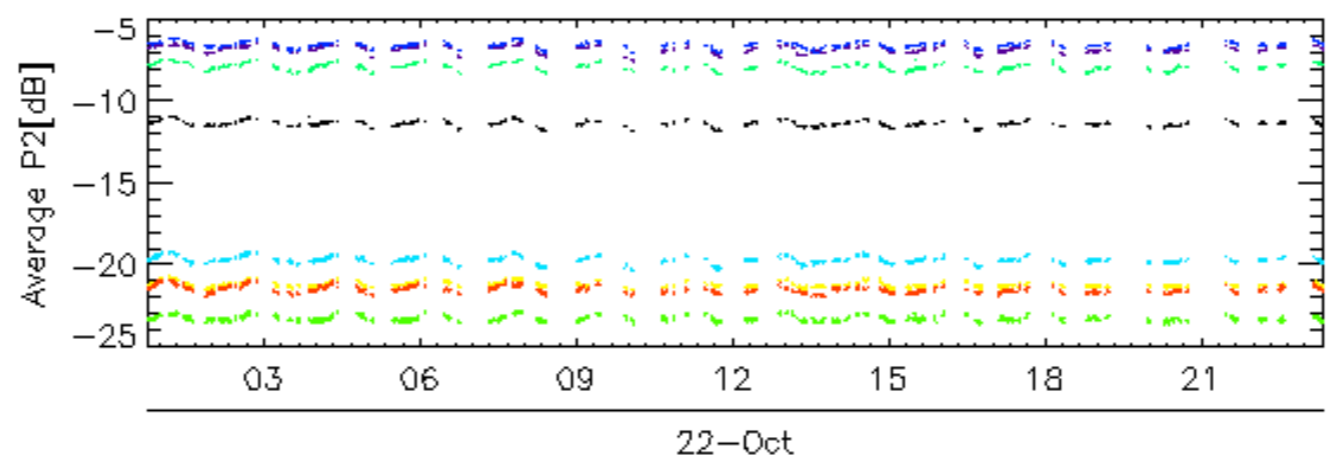
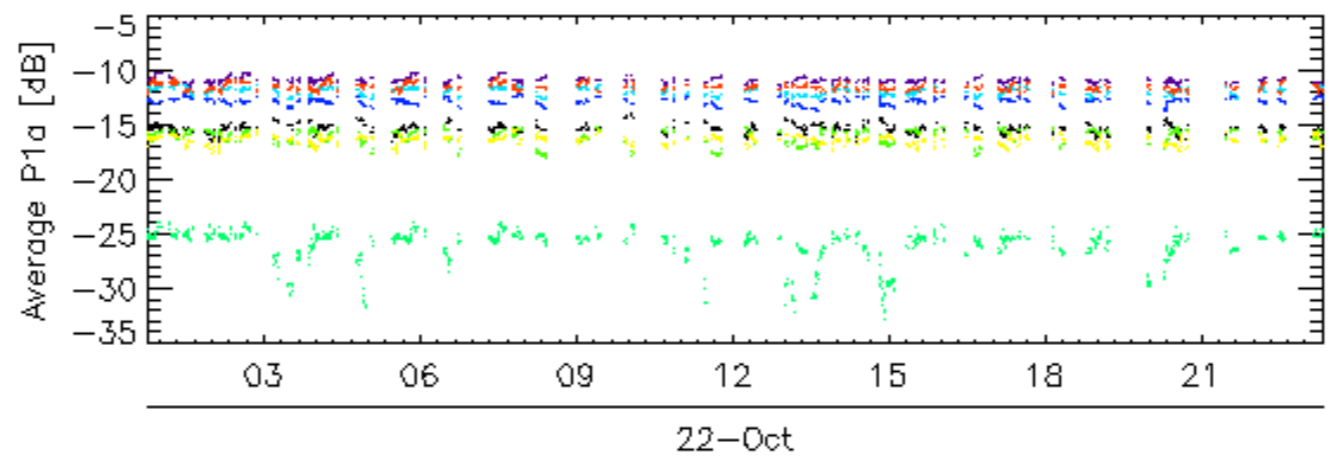
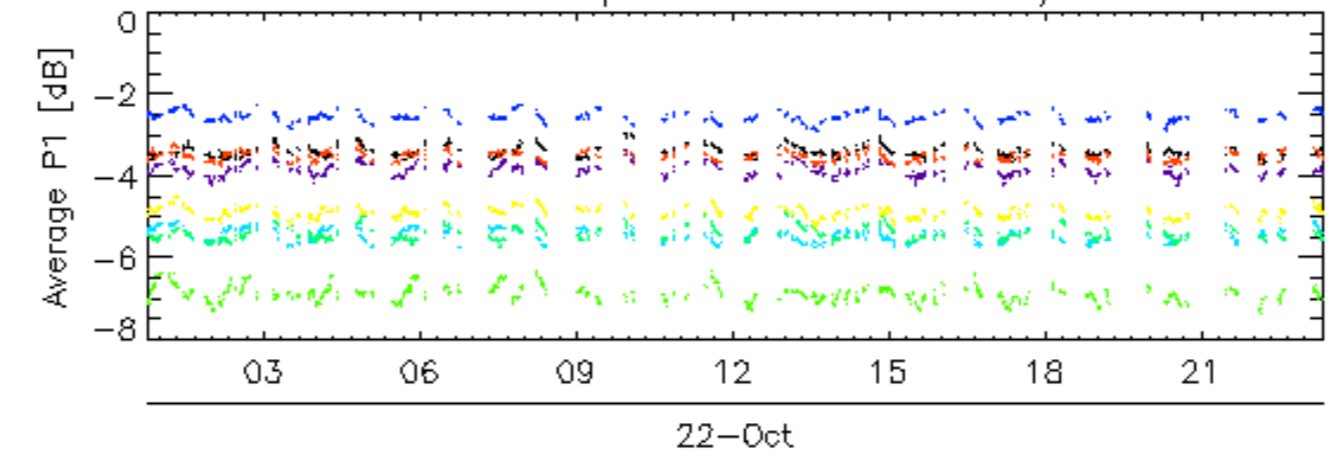


rows: 10 14 18 2 22 26 30 6

Calibration pulses for GM1 SS3 H/H

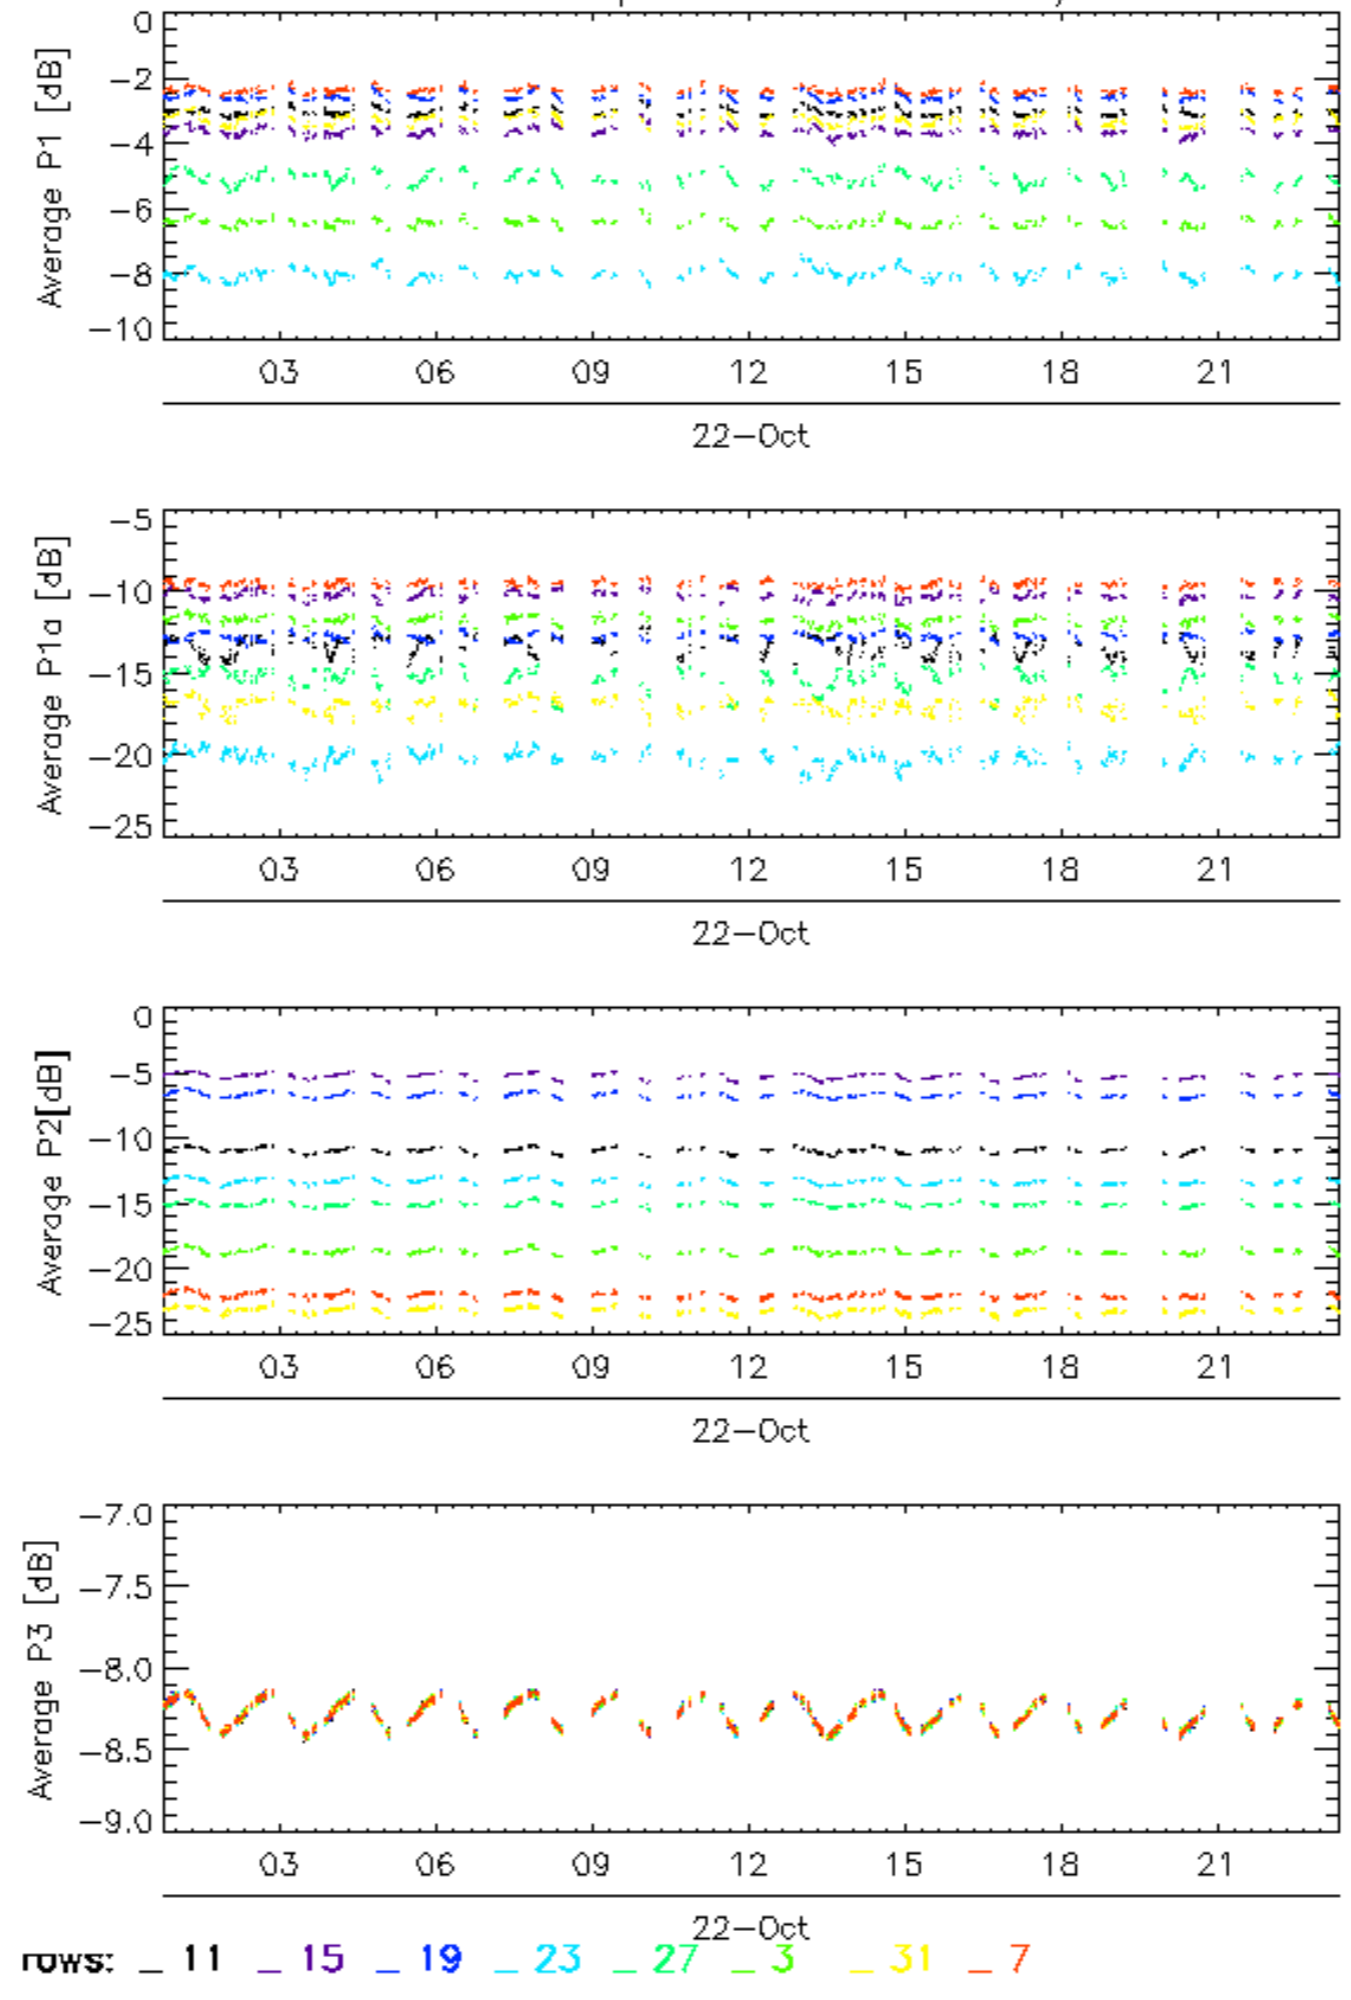


Calibration pulses for GM1 SS3 H/H

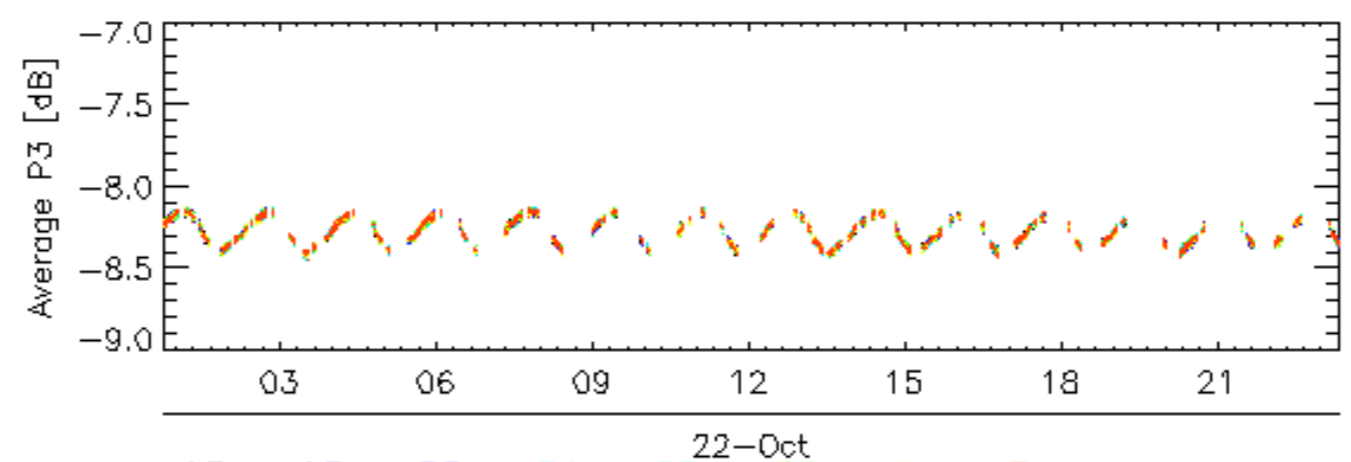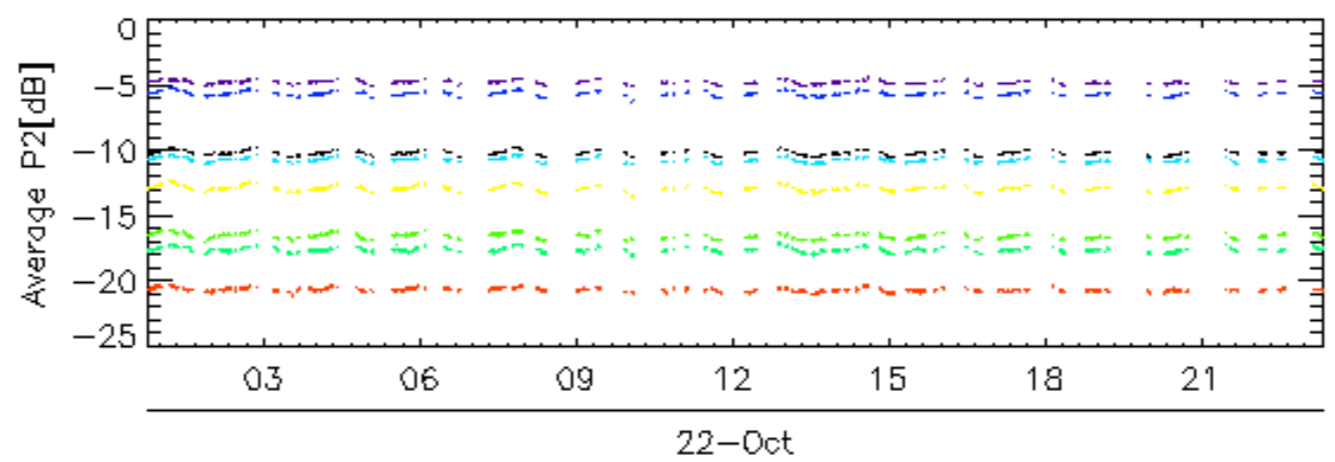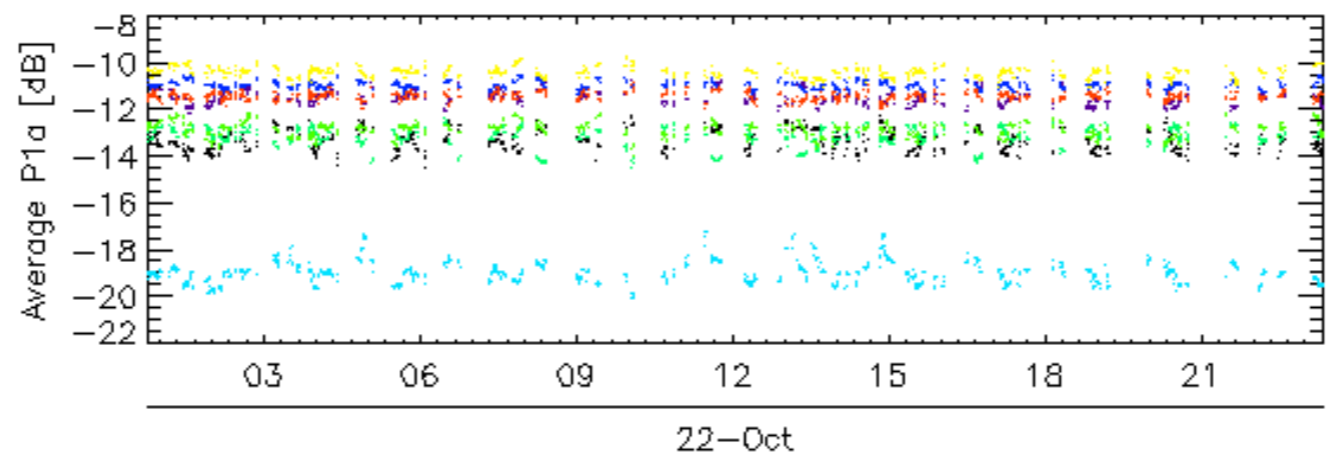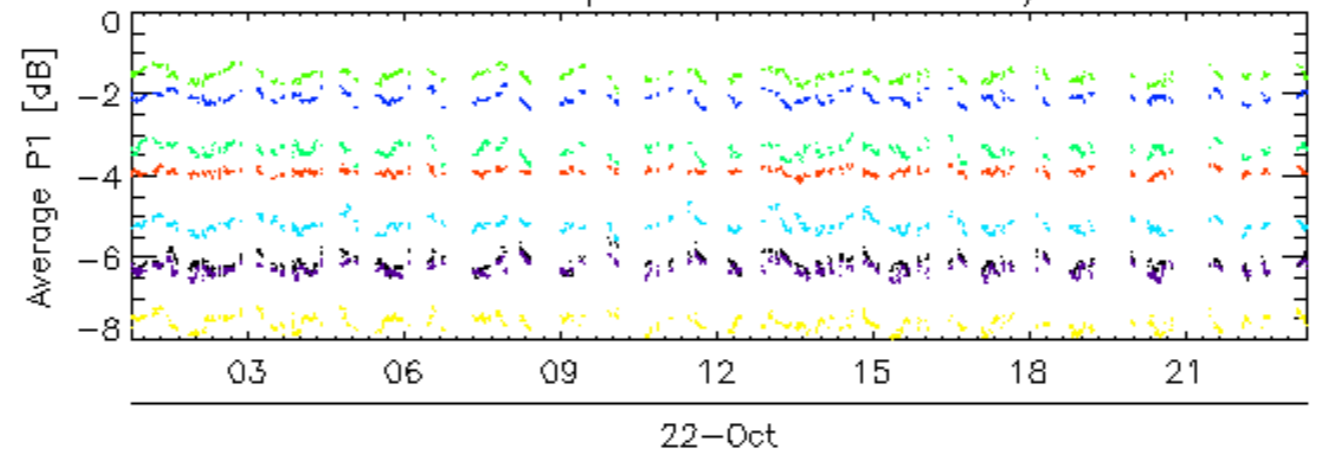


rows: — 12 — 16 — 20 — 24 — 28 — 32 — 4 — 8


Calibration pulses for WVS IS2 V/V

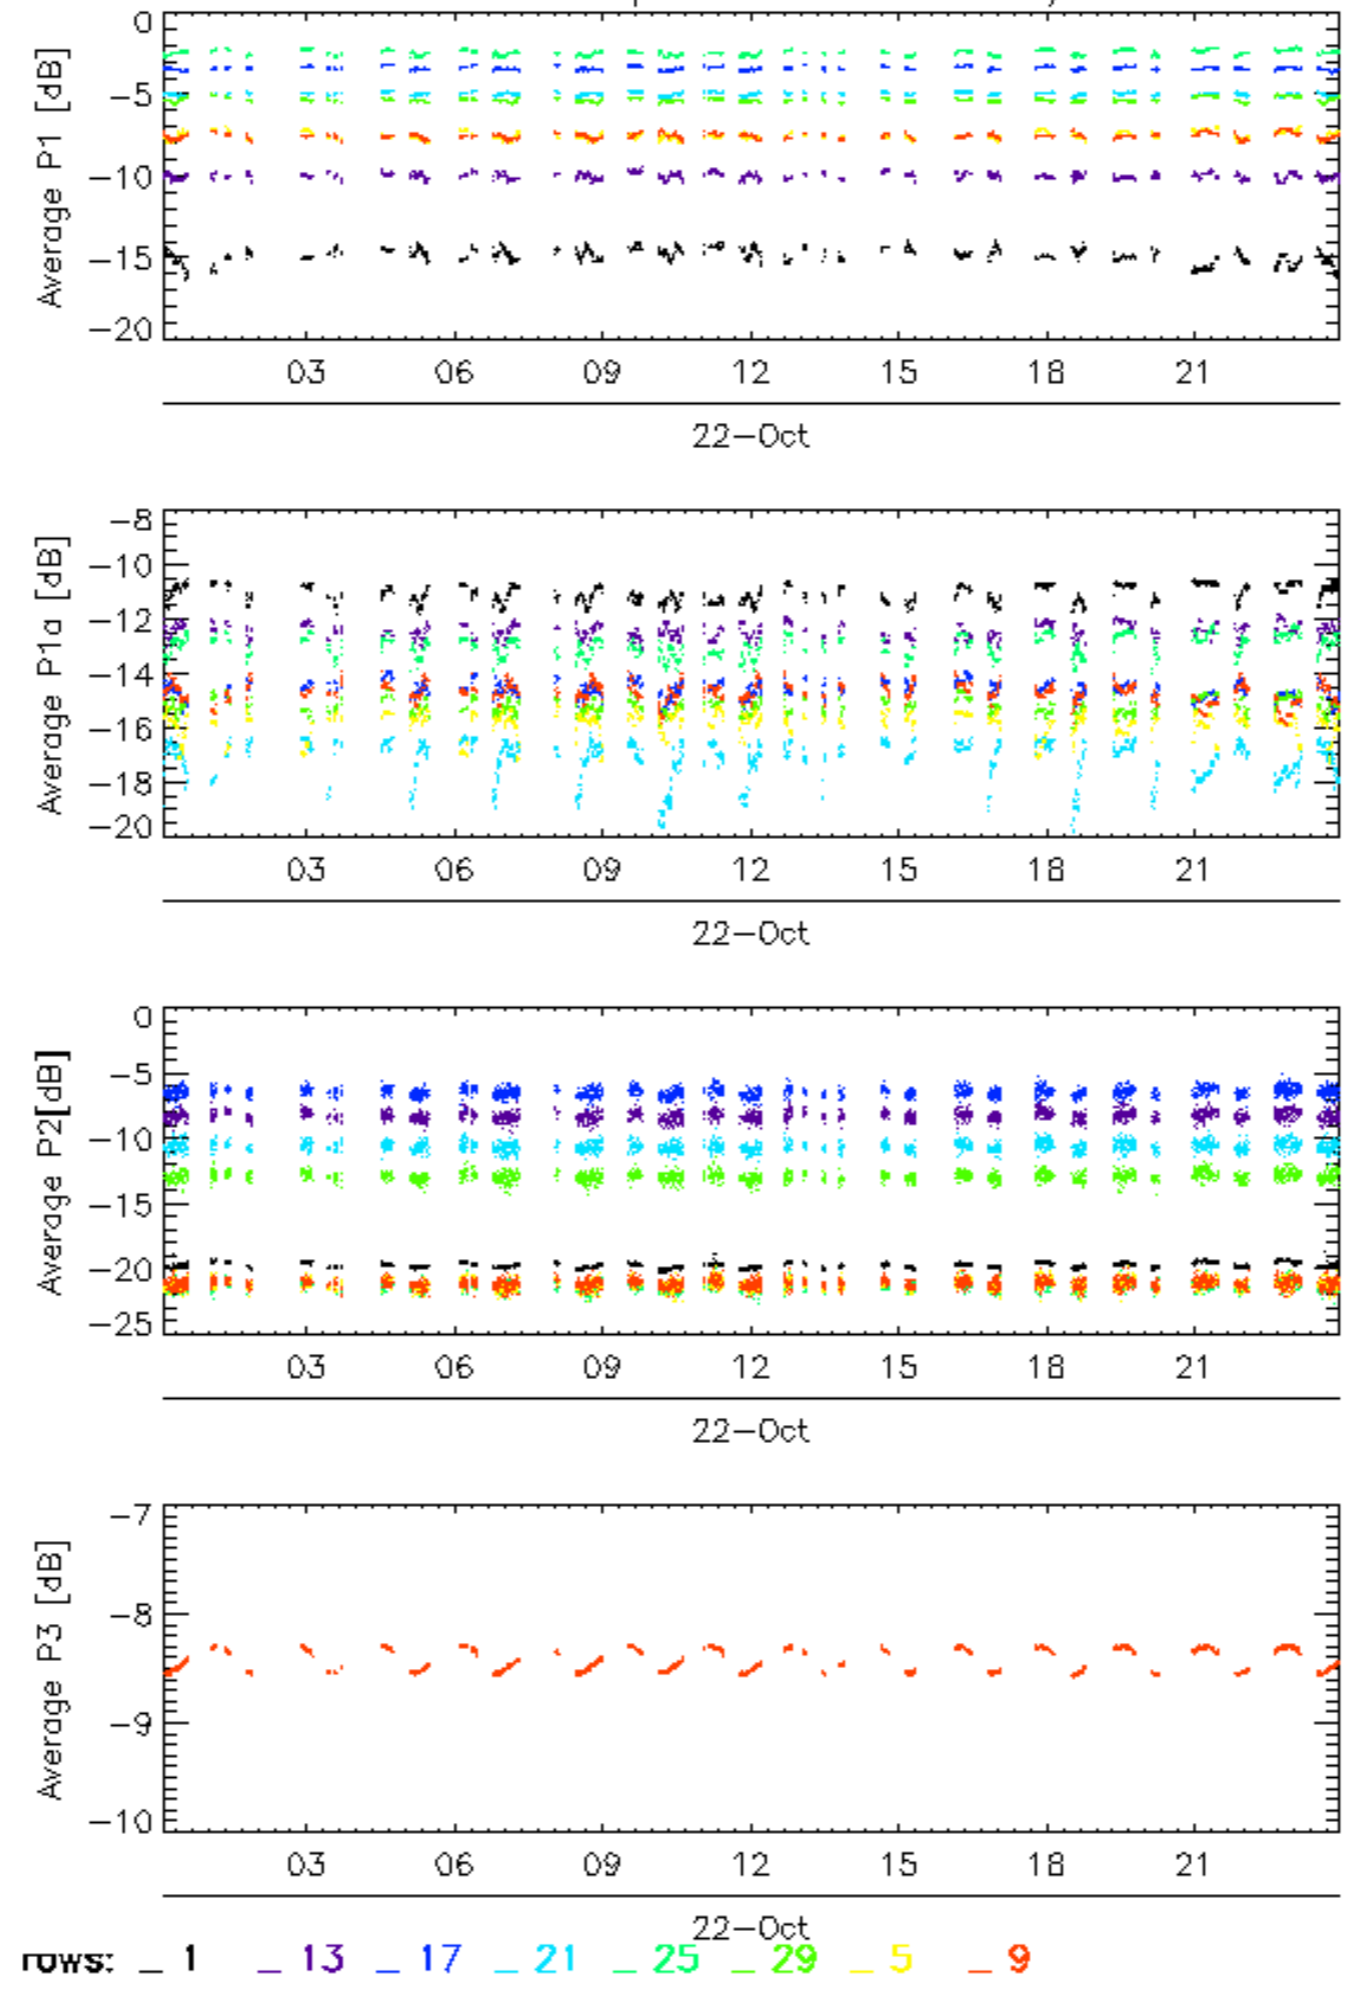


Calibration pulses for WVS IS2 V/V

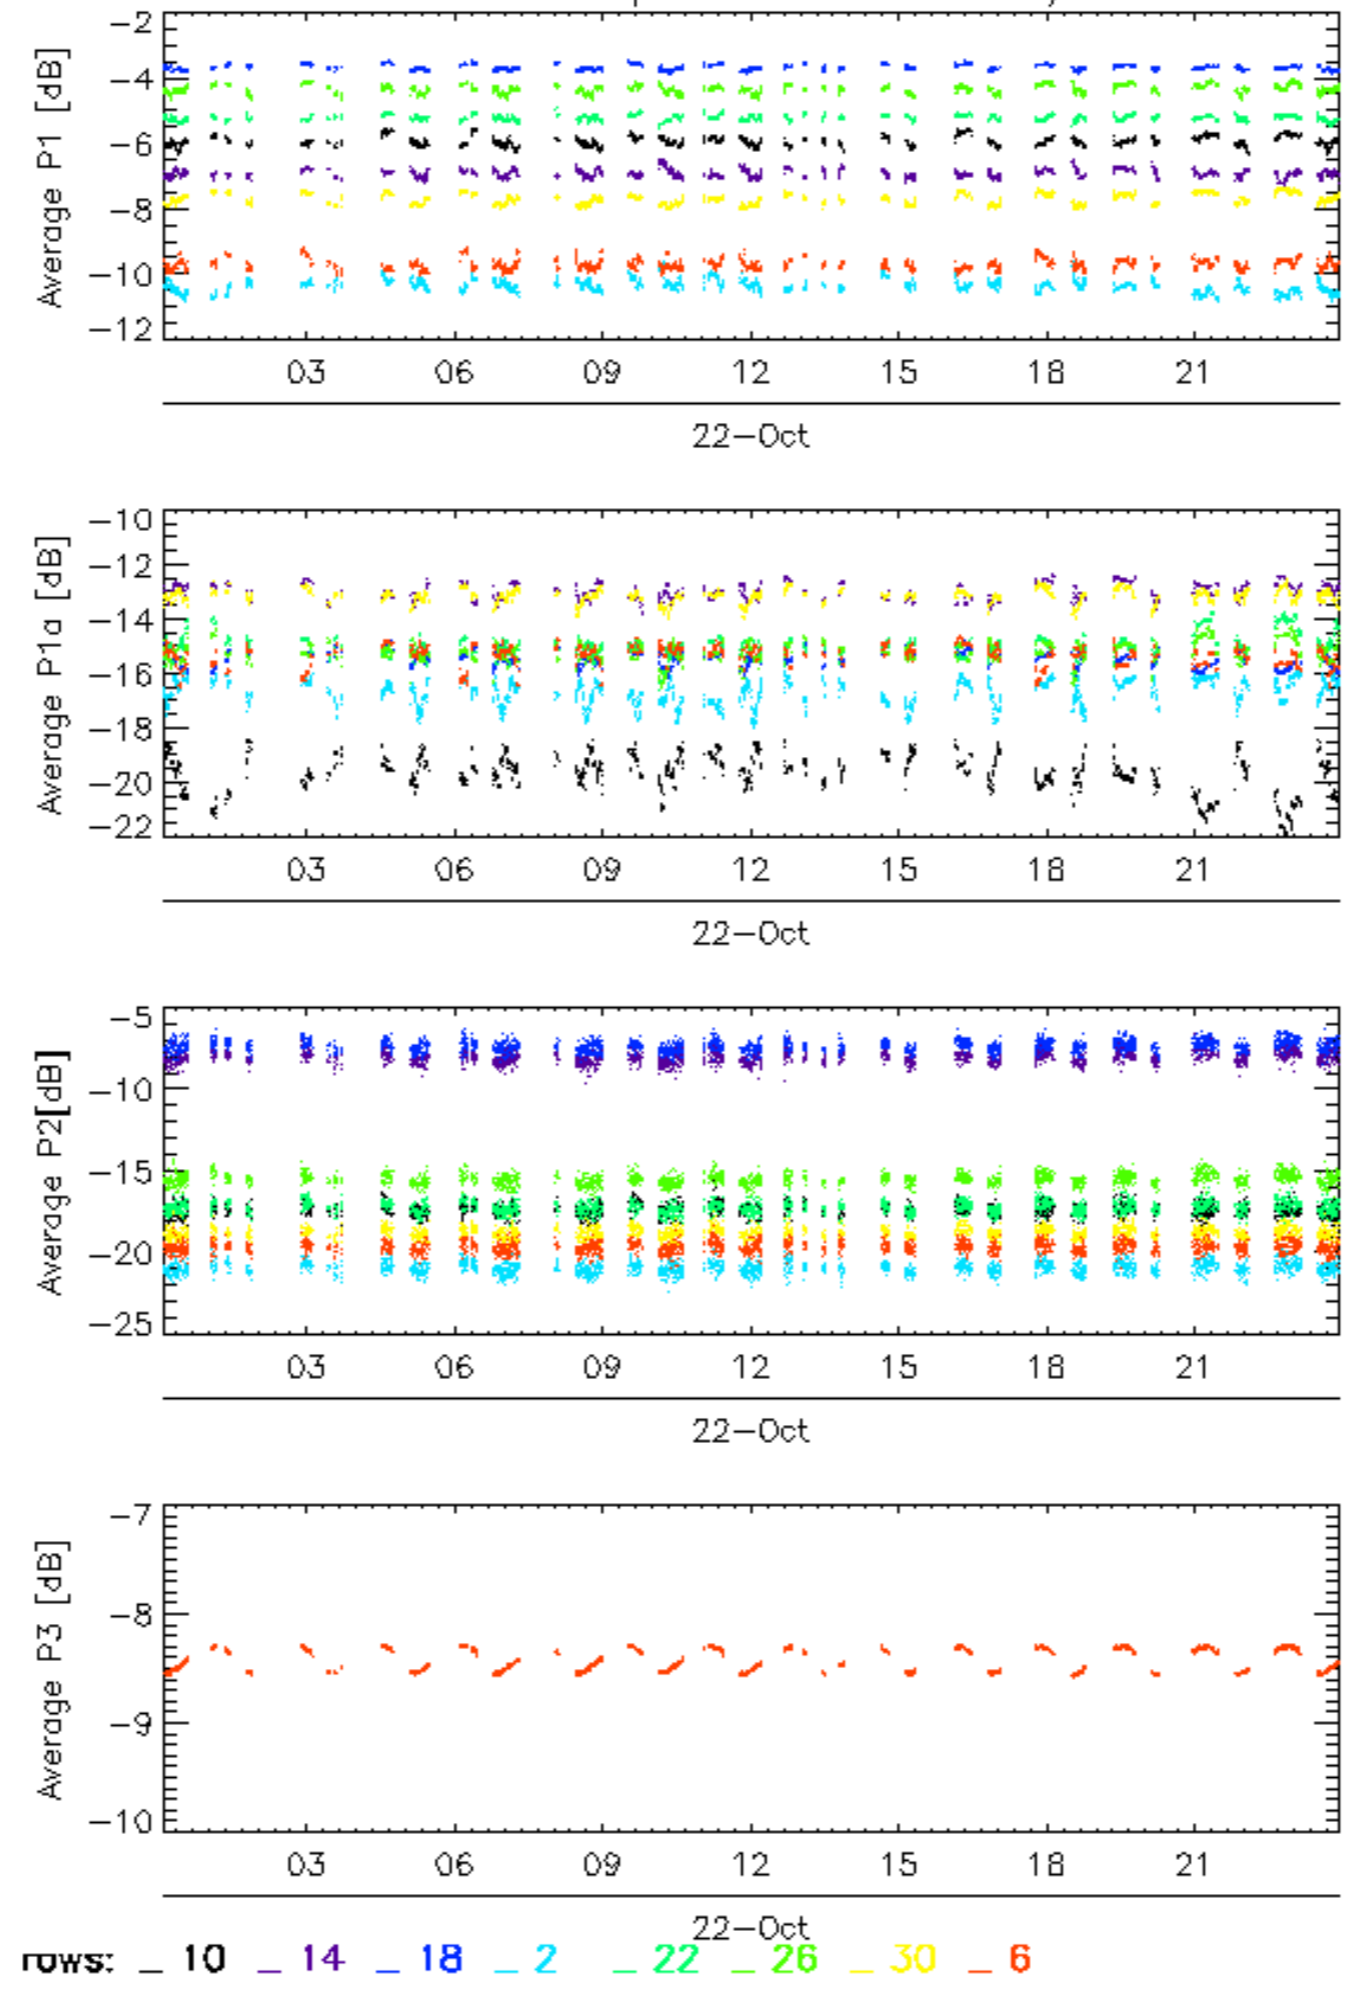


Calibration pulses for WVS IS2 V/V

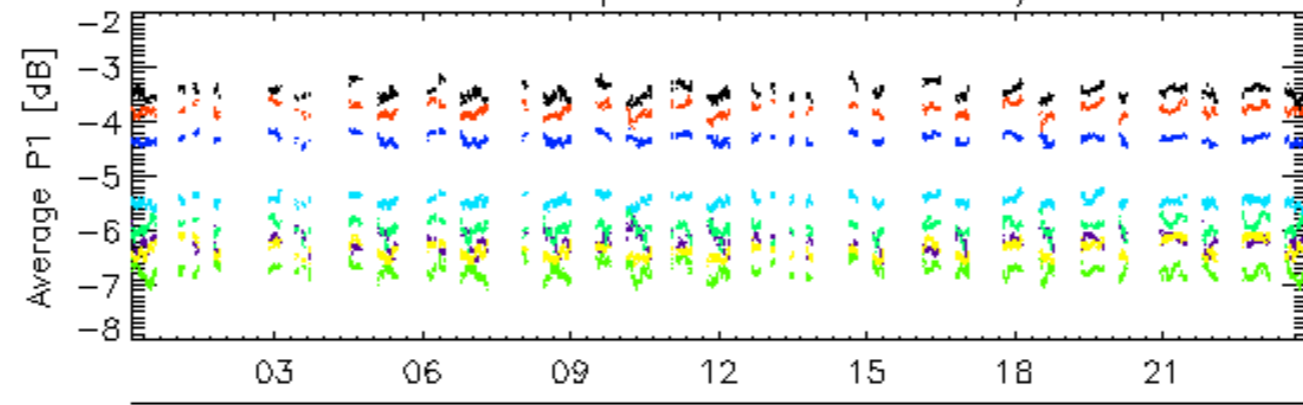


22-Oct

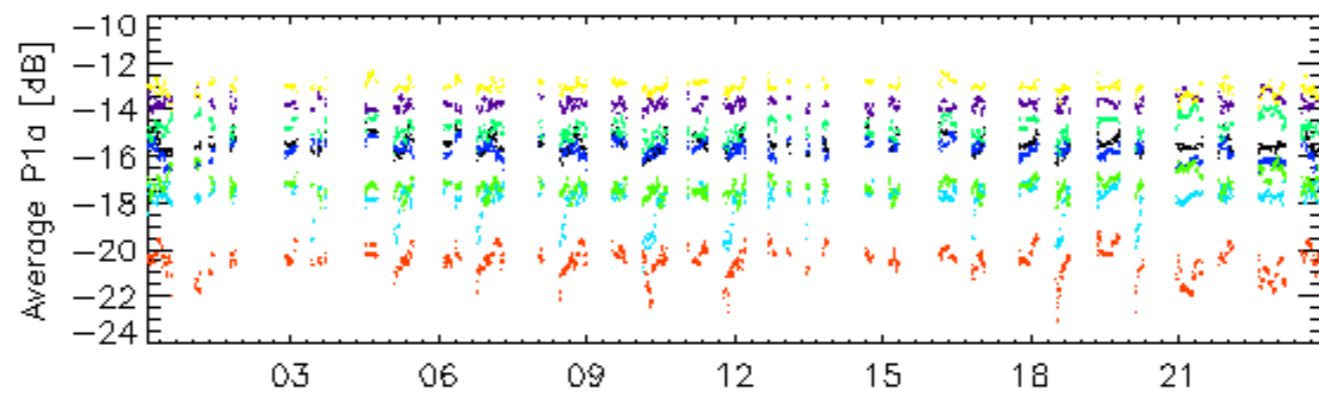

22-Oct

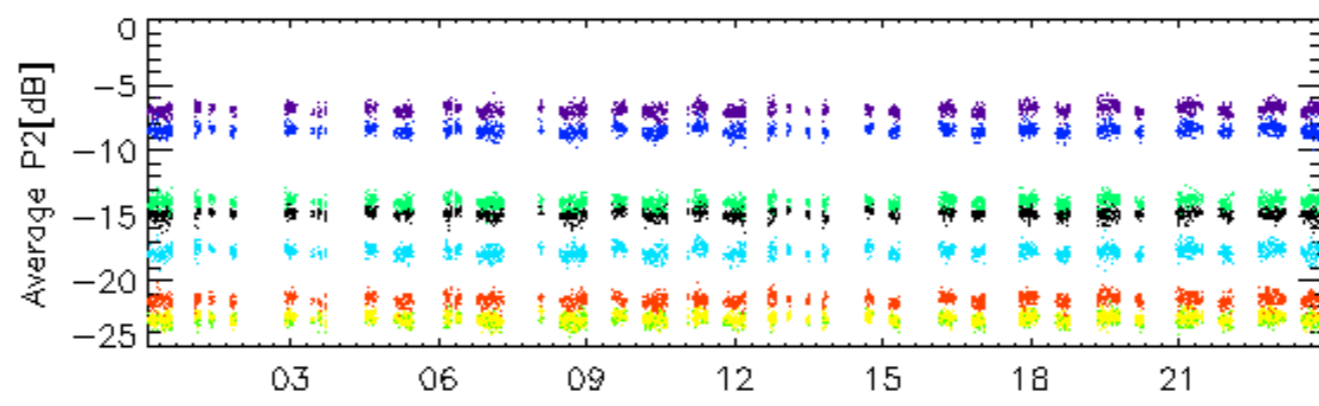


22-Oct

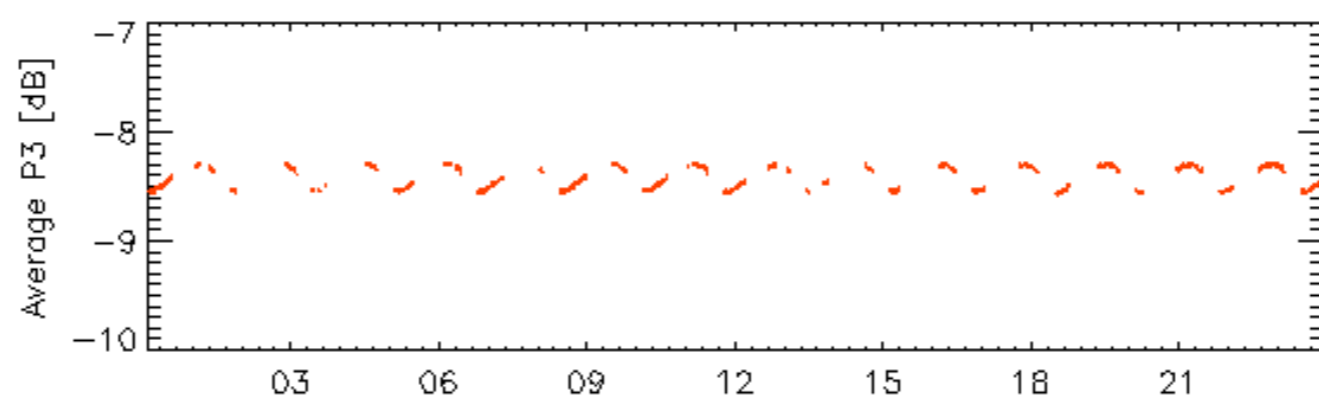


22-Oct

rows: _ 11 _ 15 _ 19 _ 23 _ 27 _ 3 _ 31 _ 7


Calibration pulses for WVS IS2 V/V

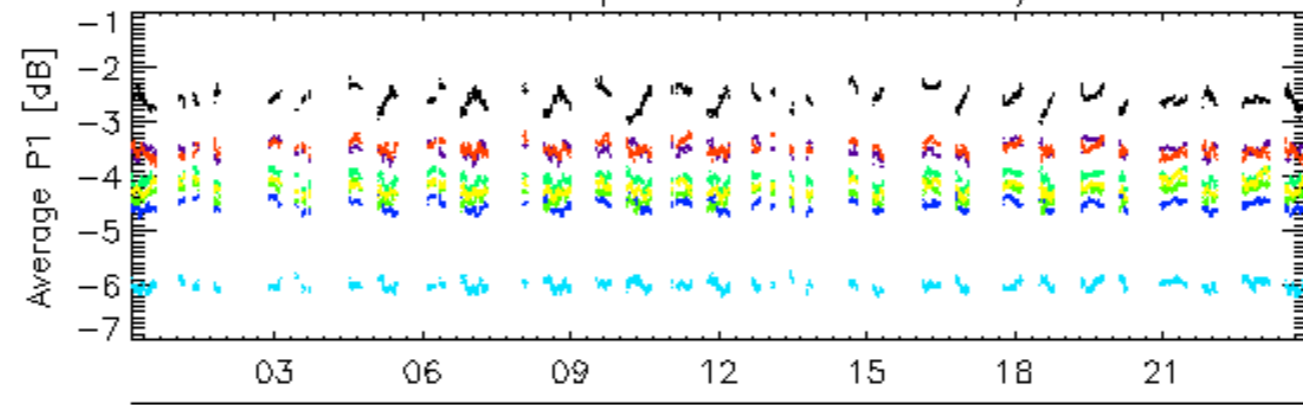


22-Oct

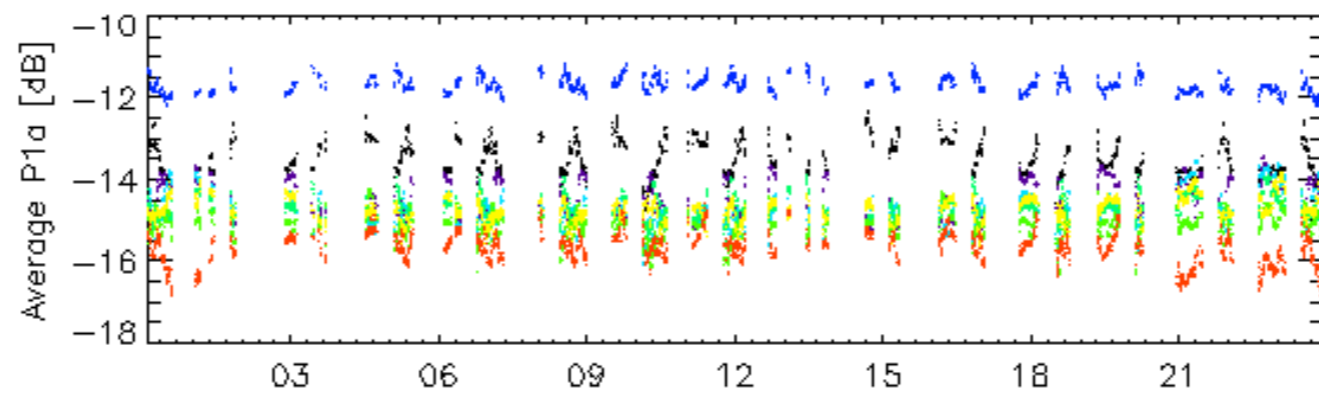

22-Oct

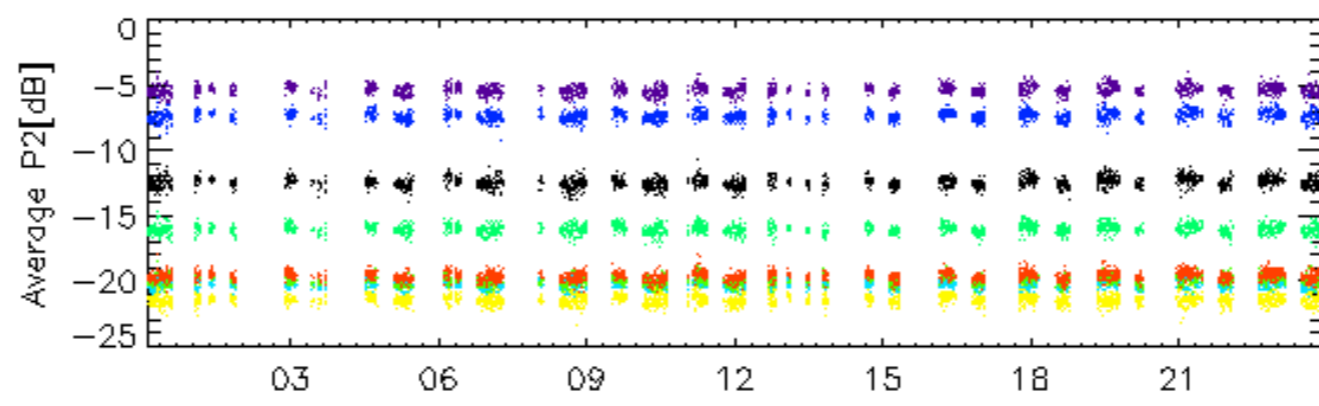



22-Oct


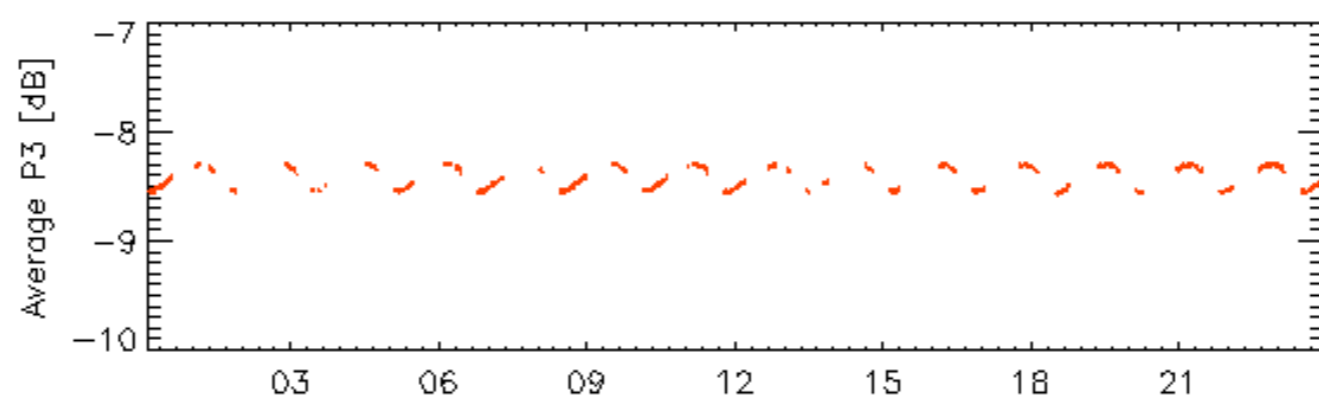


22-Oct



rows: _ 12 _ 16 _ 20 _ 24 _ 28 _ 32 _ 4 _ 8


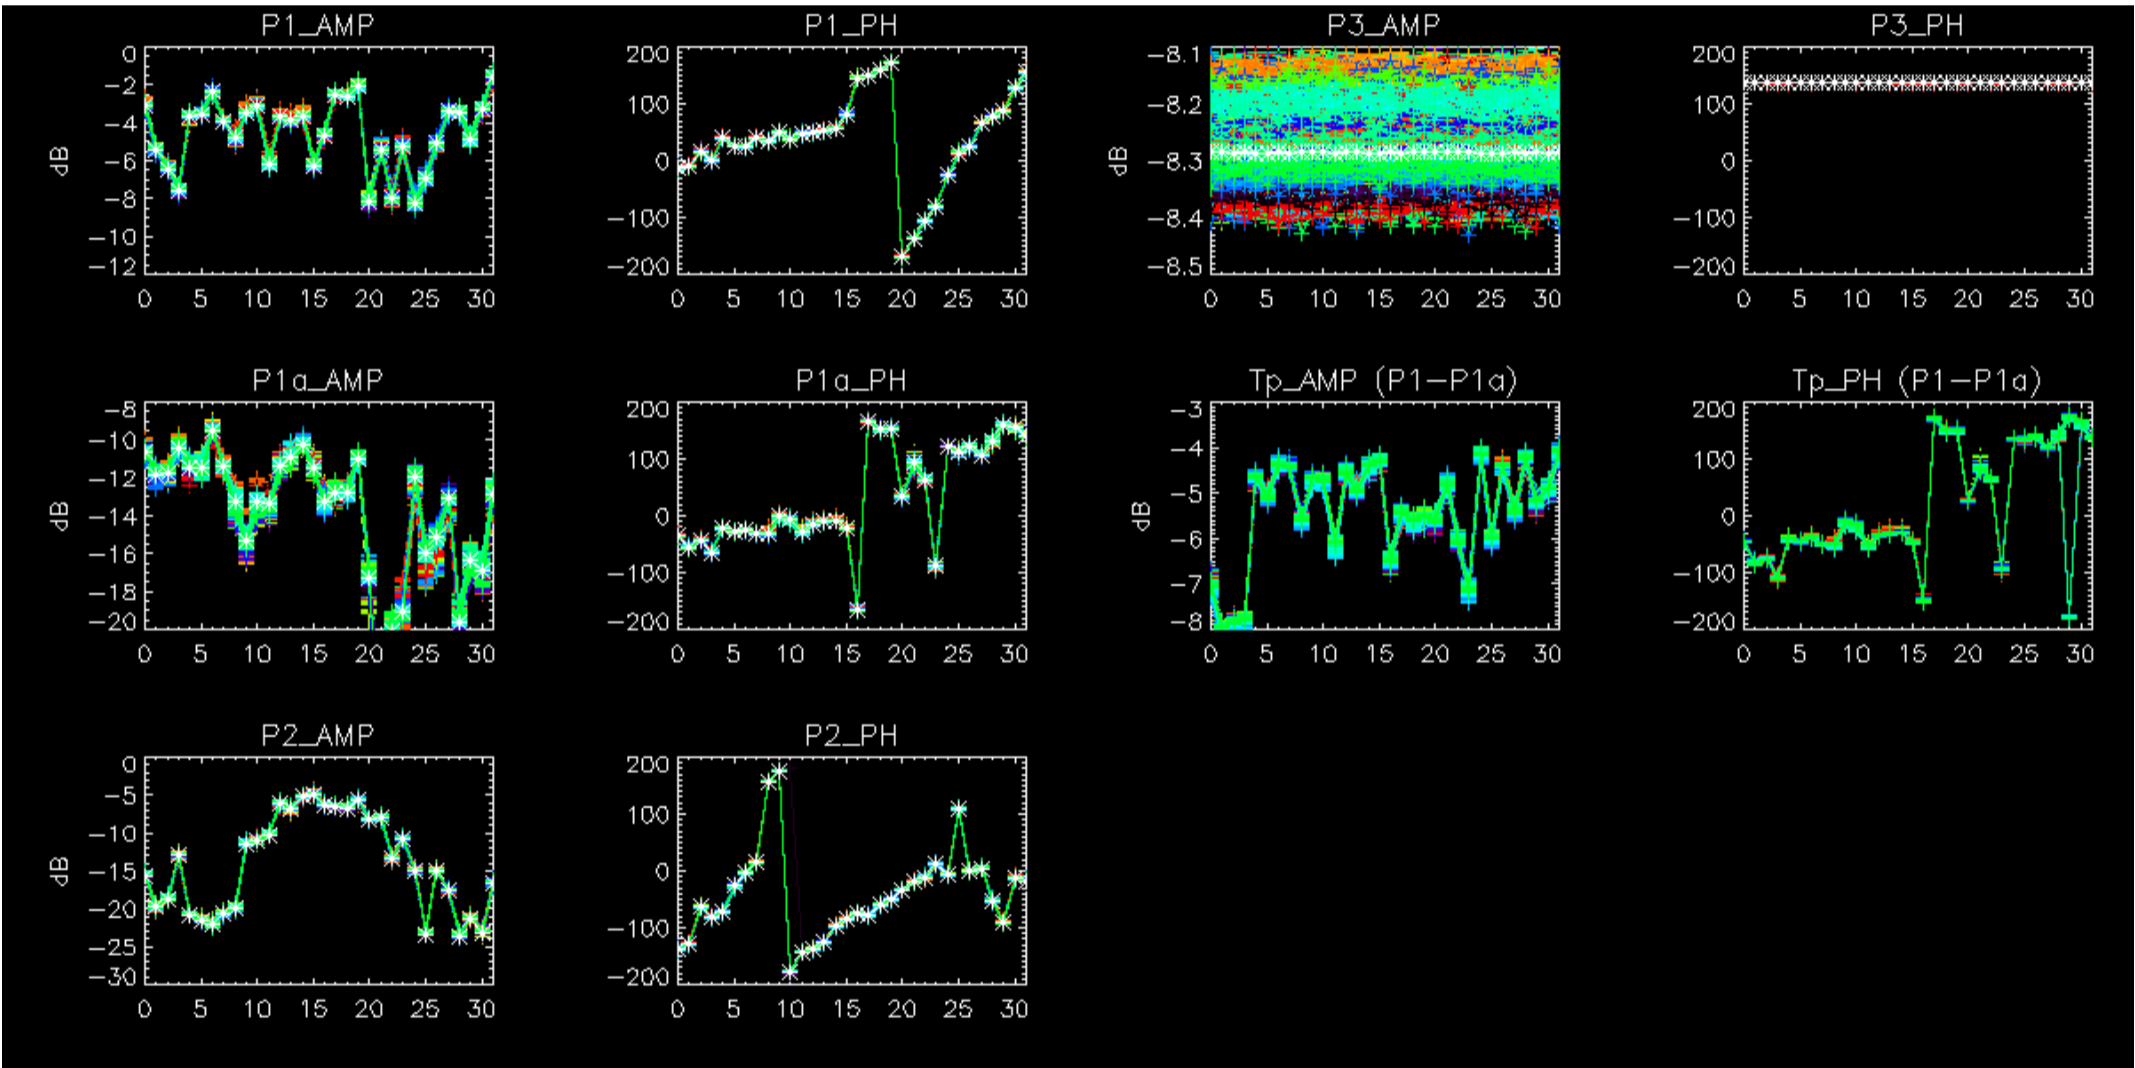


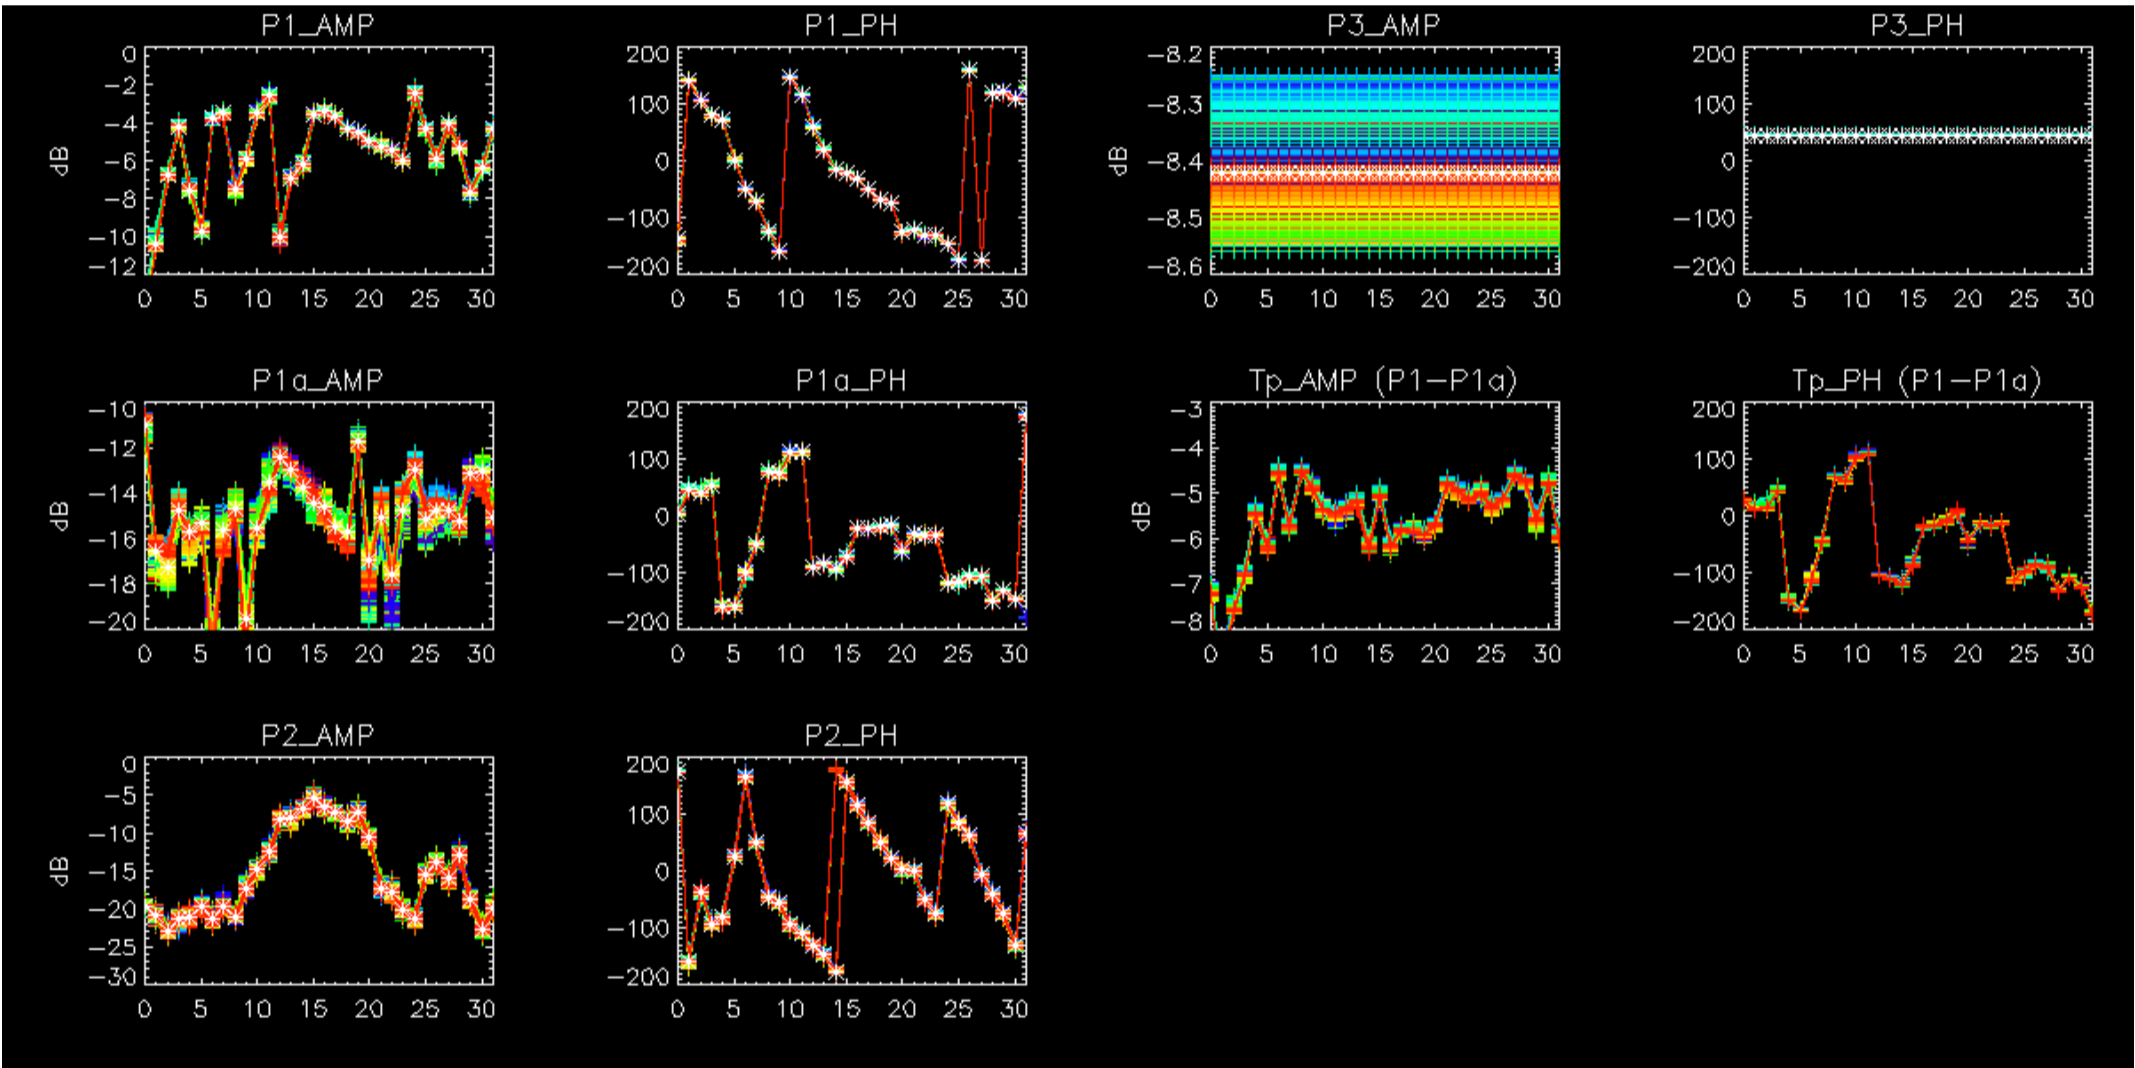

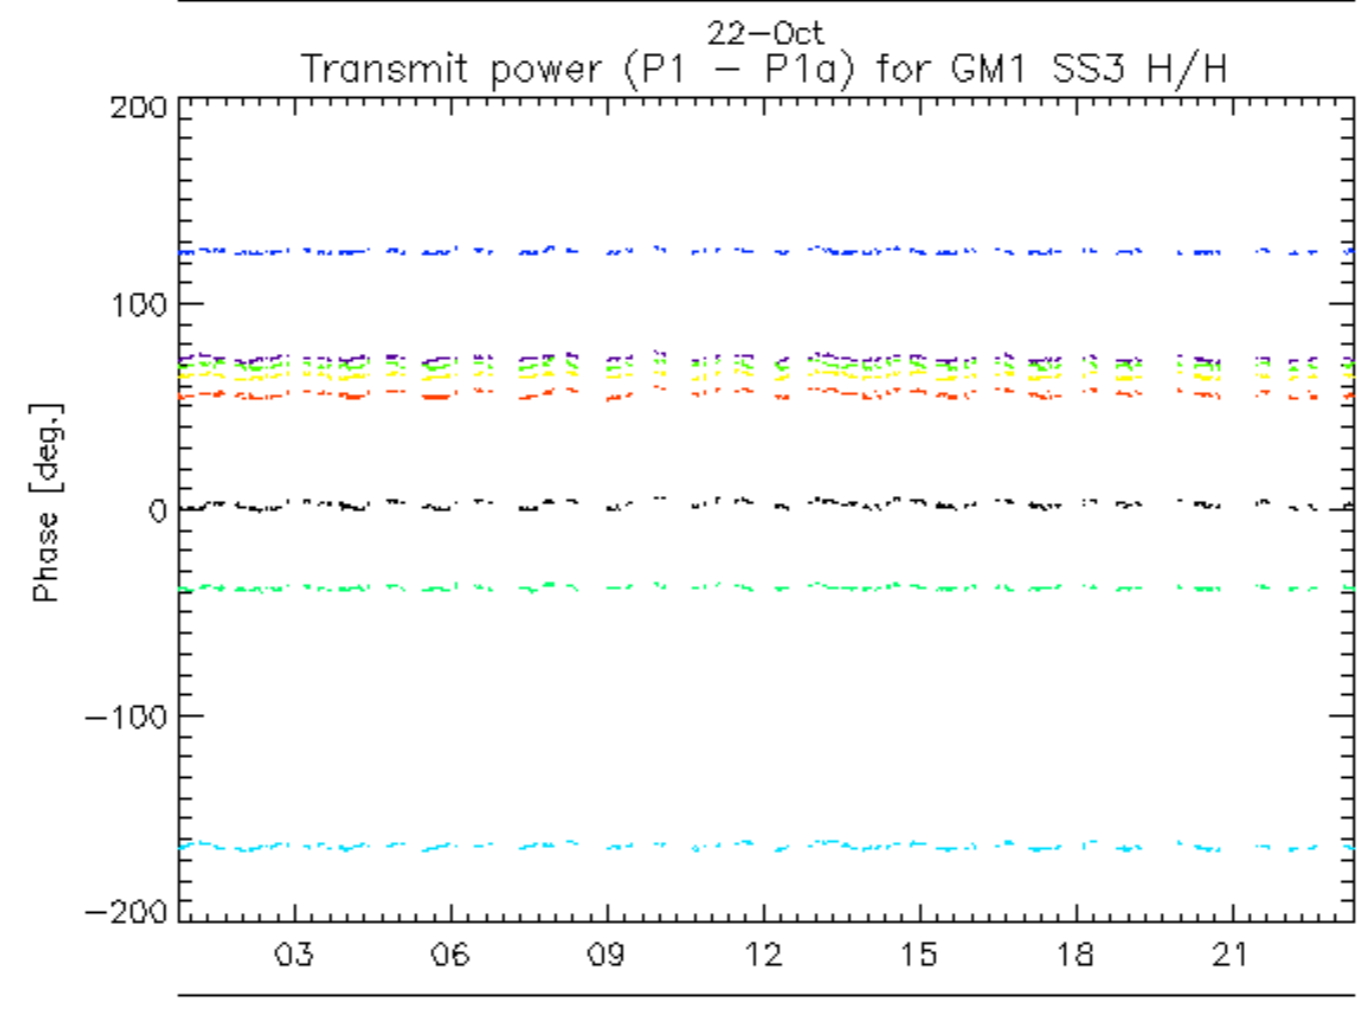
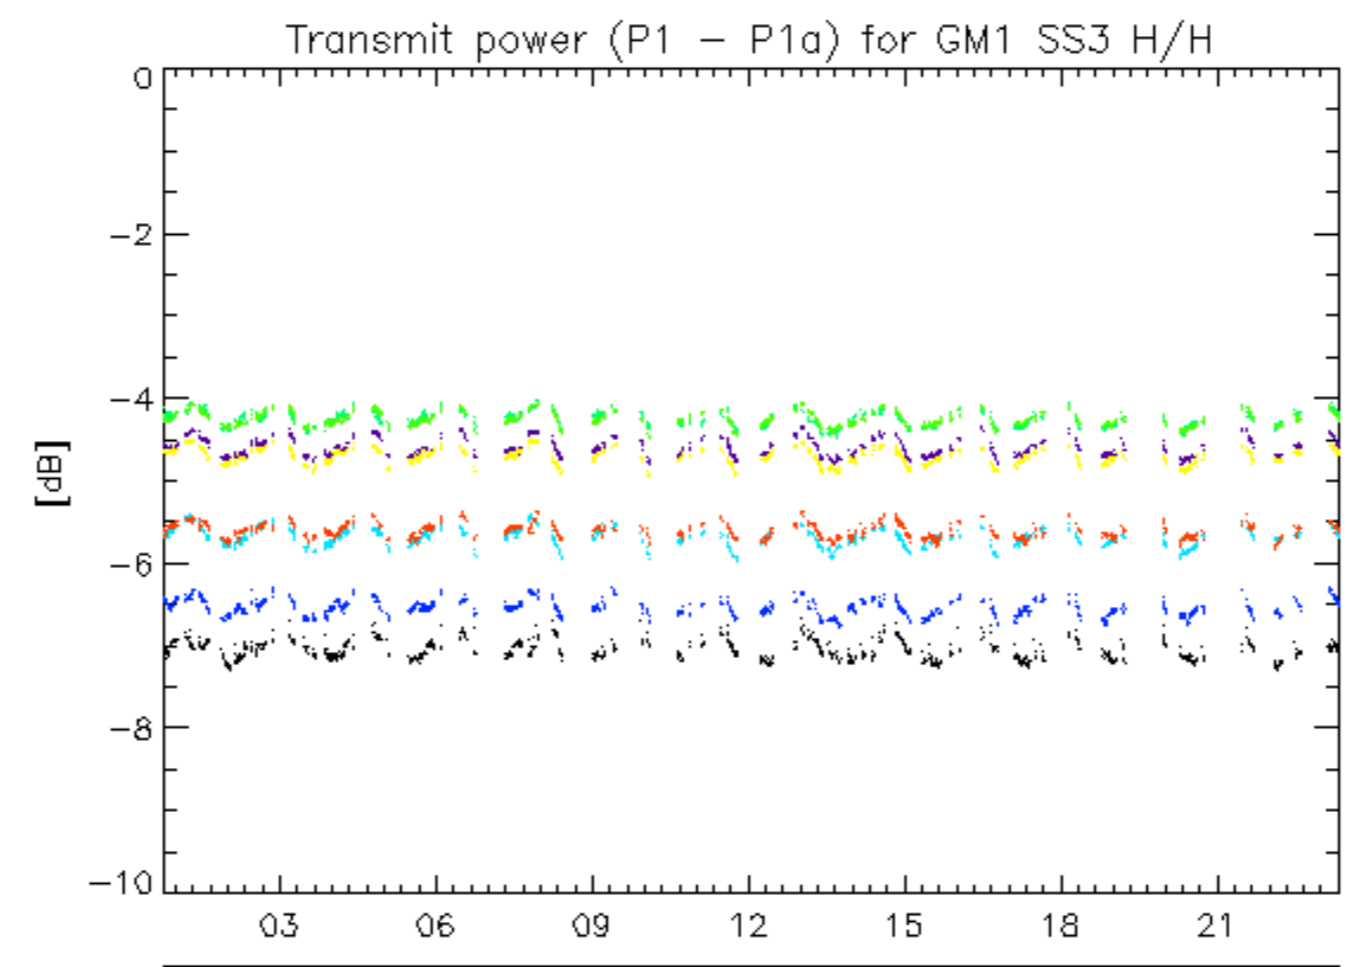




rows: _ 1 _ 13 _ 17 _ 21 _ 25 _ 29 _ 5 _ 9

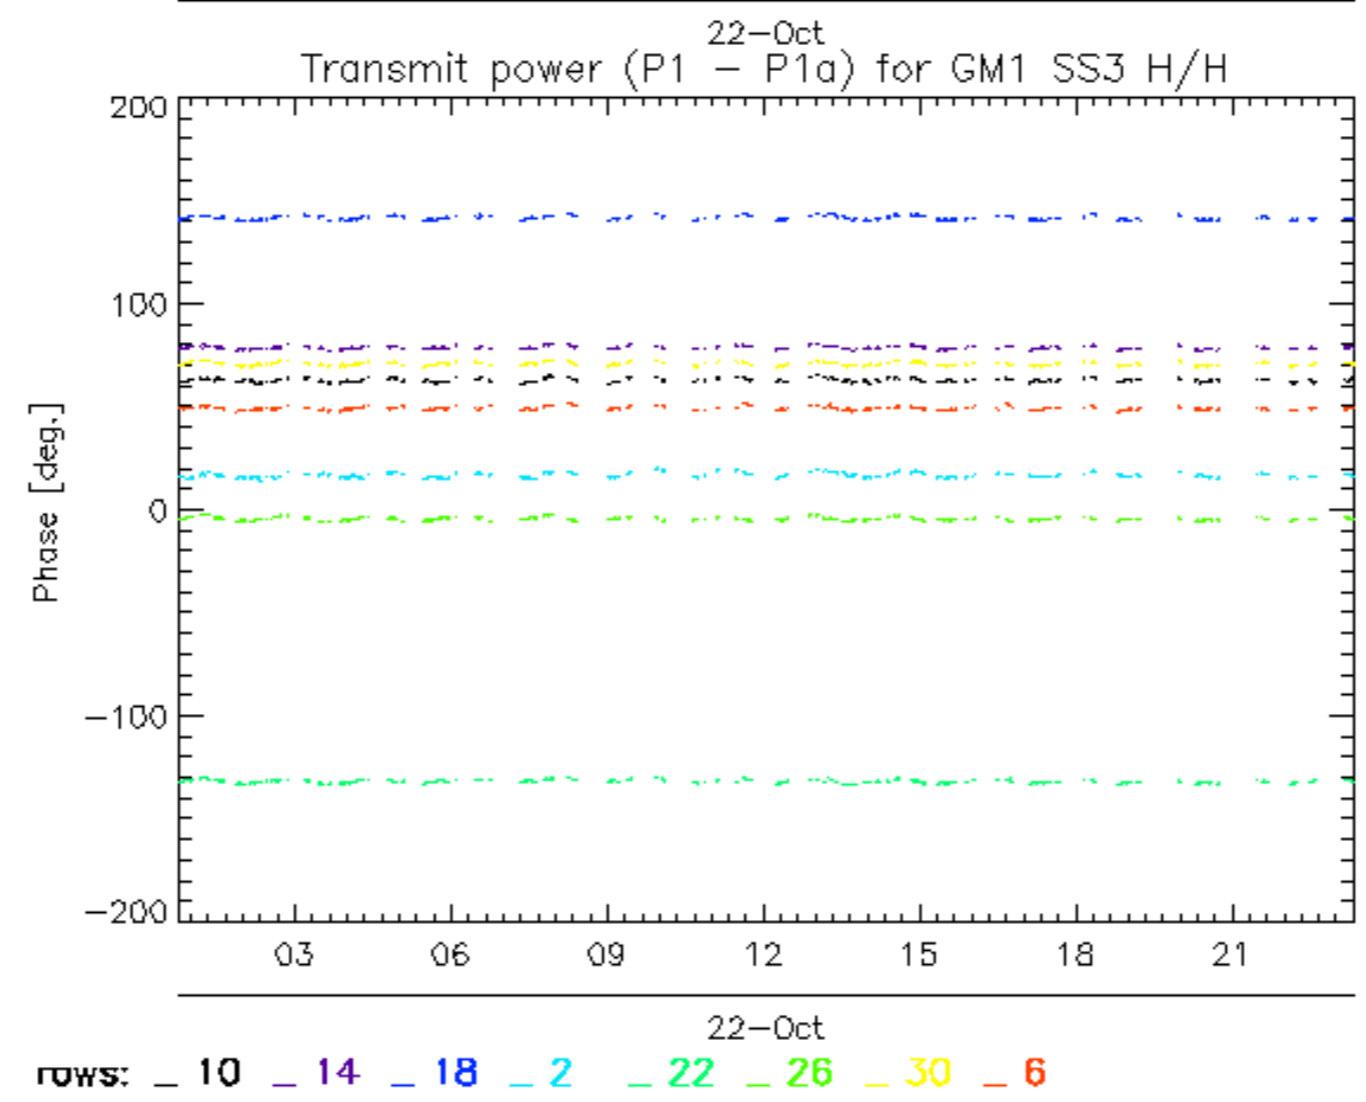
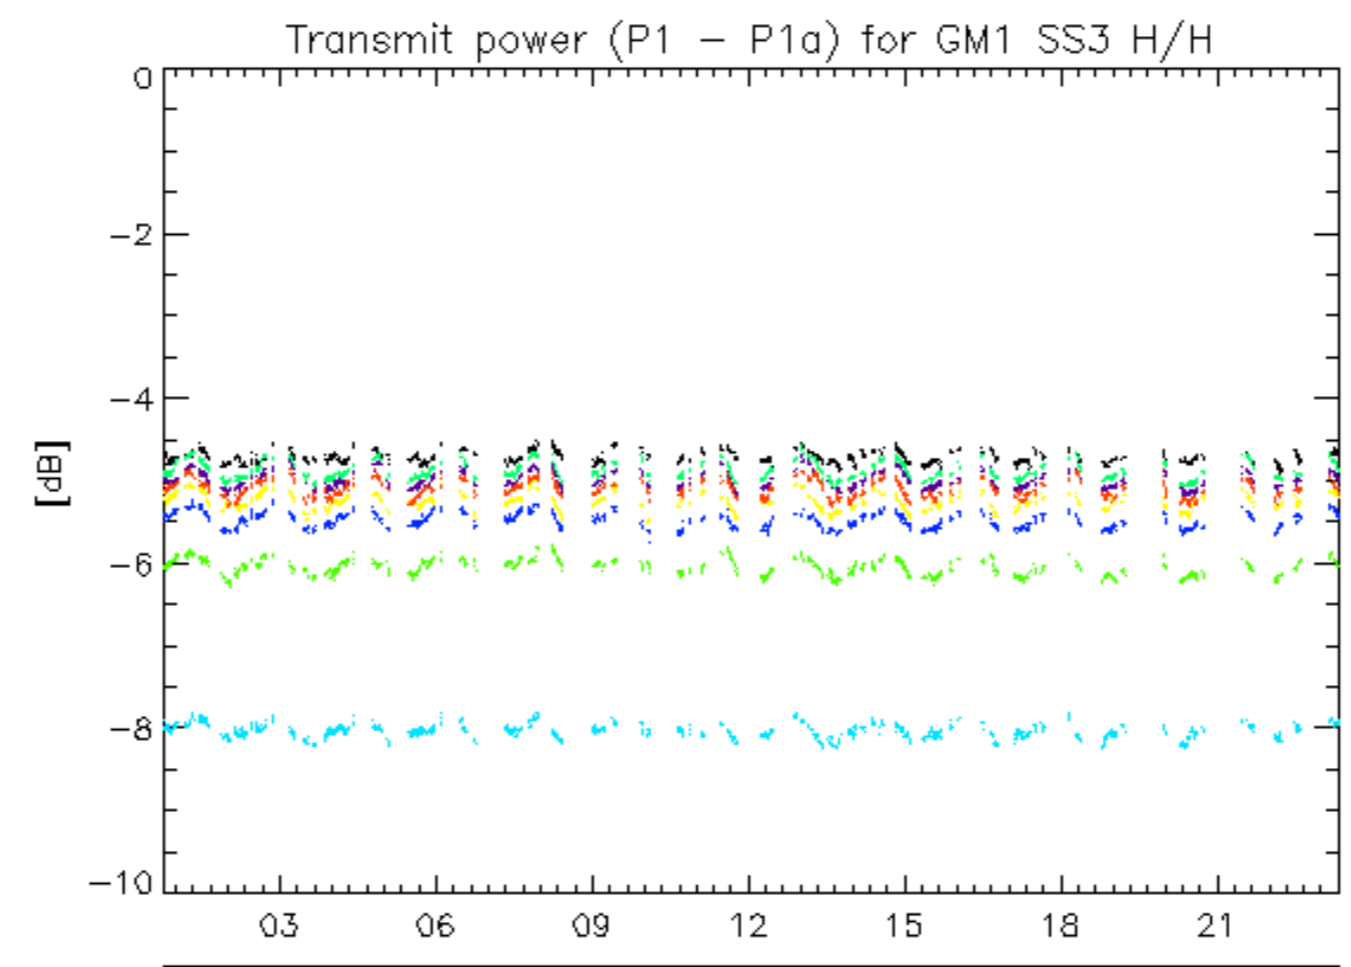


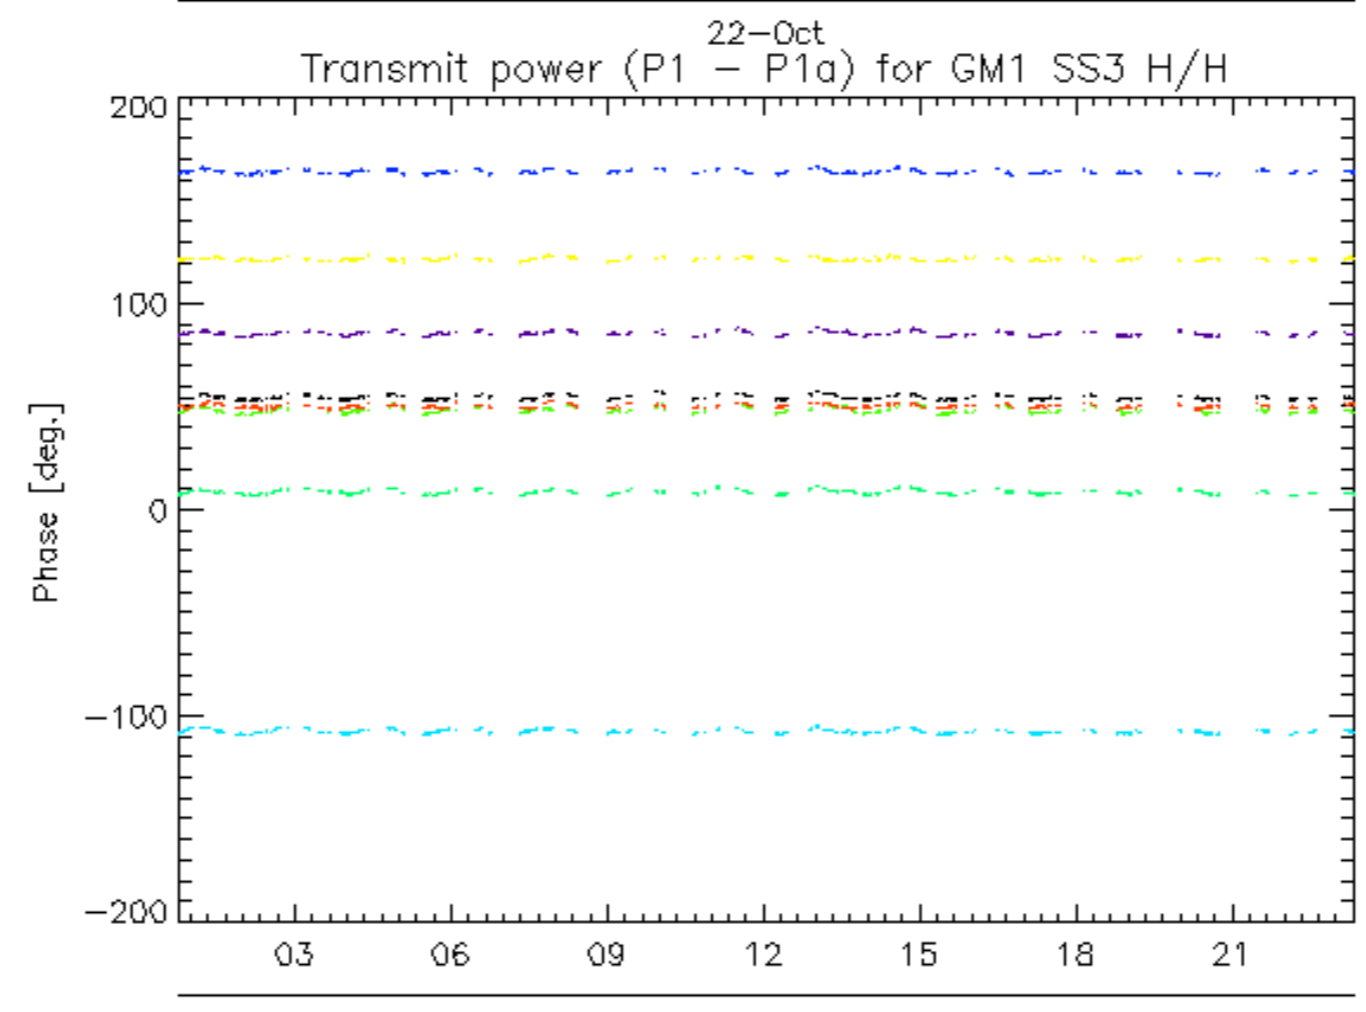
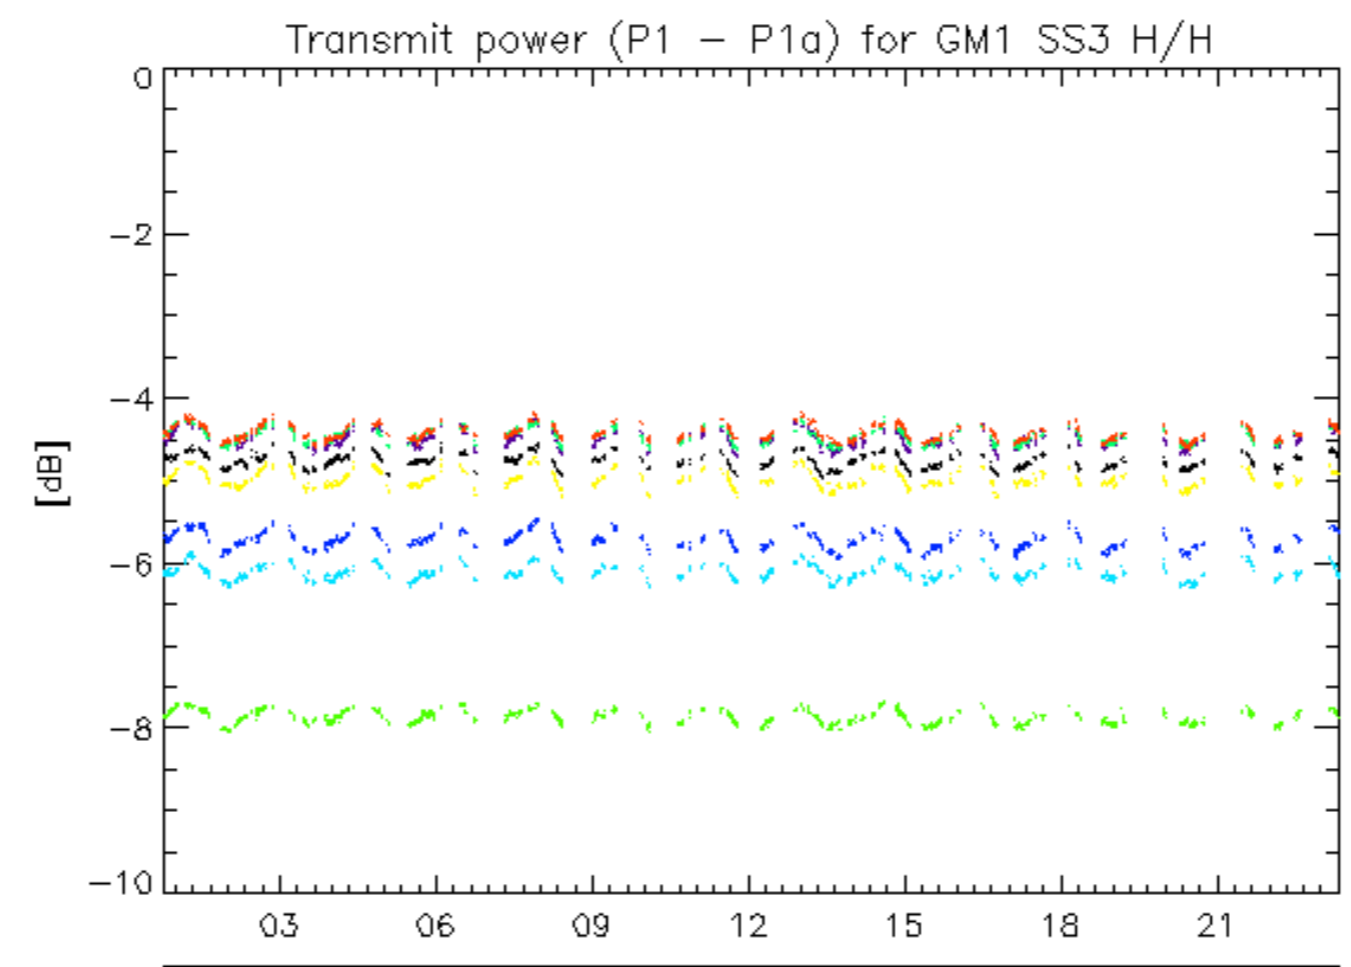


rows: _ 11 _ 15 _ 19 _ 23 _ 27 _ 31 _ 7

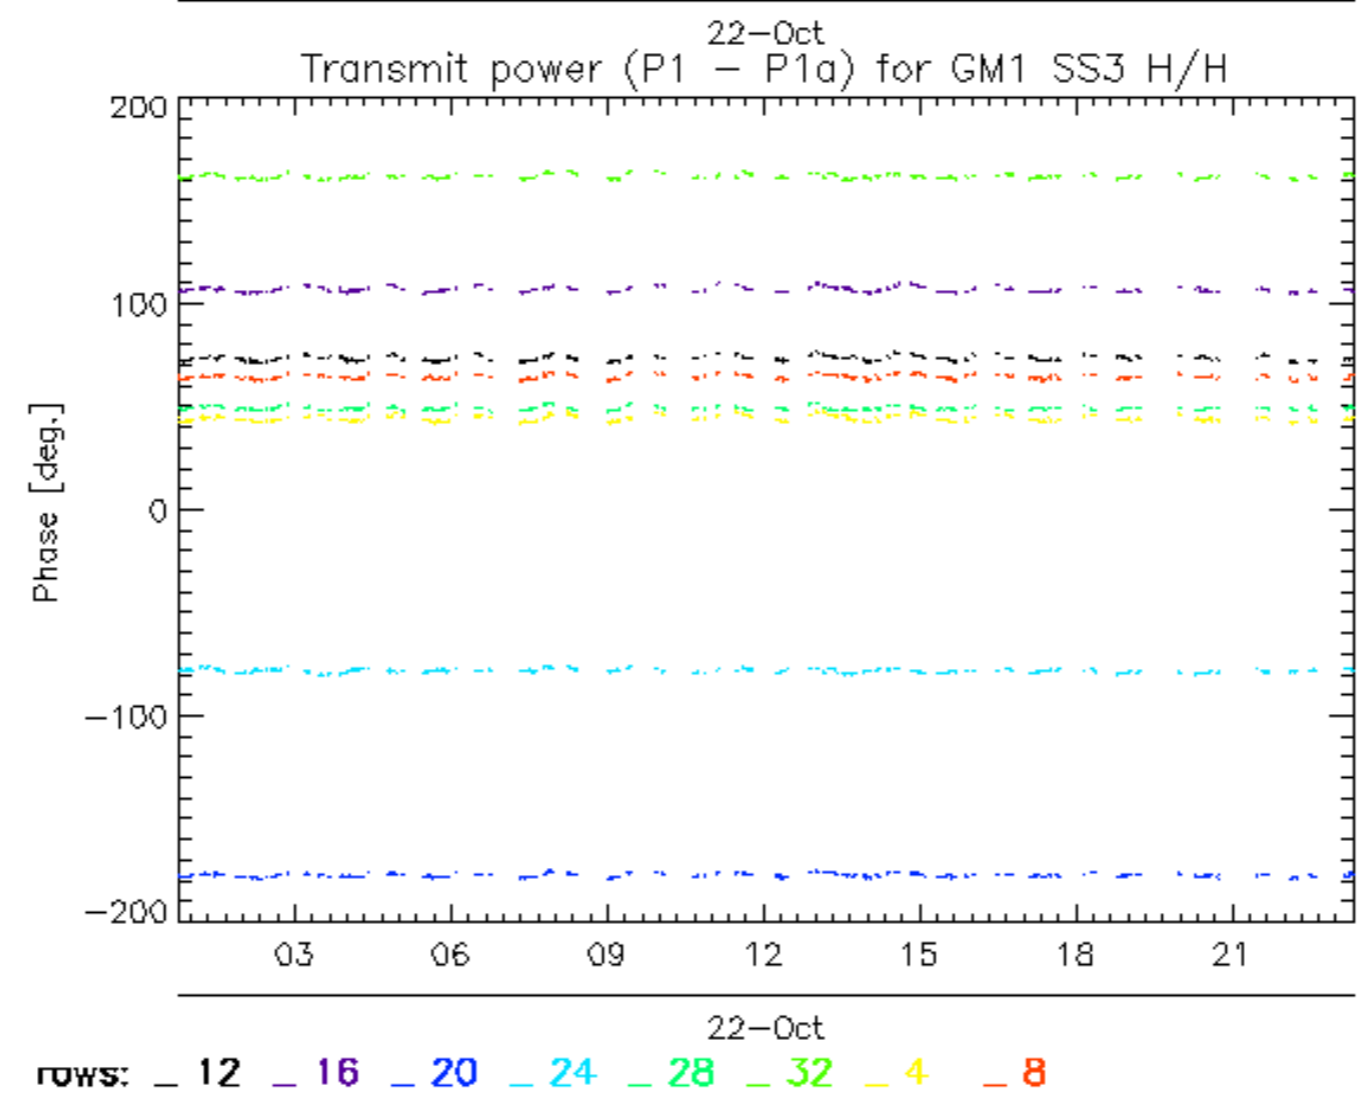
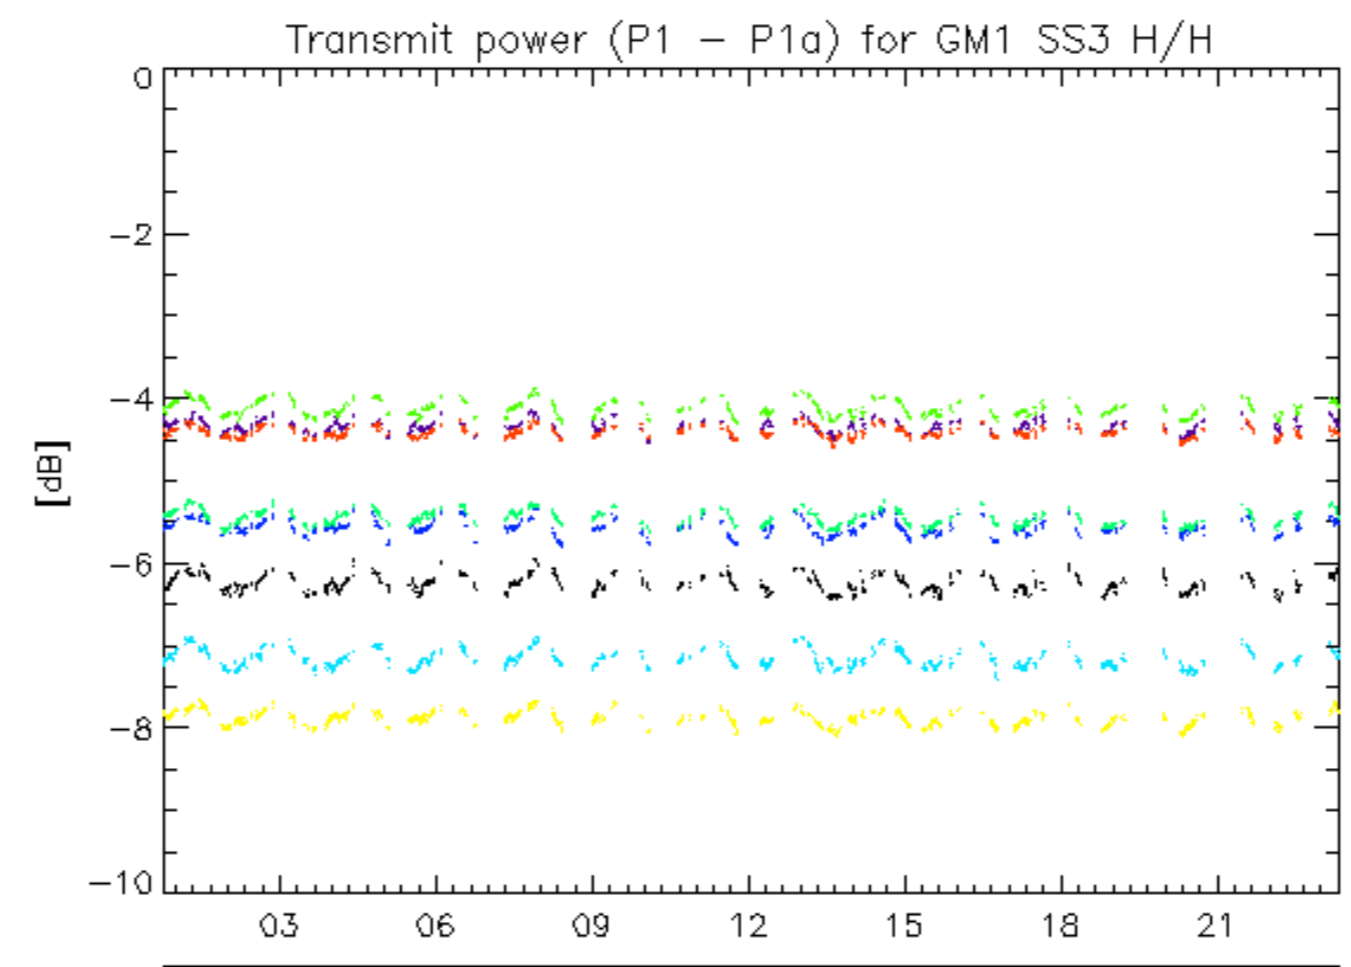


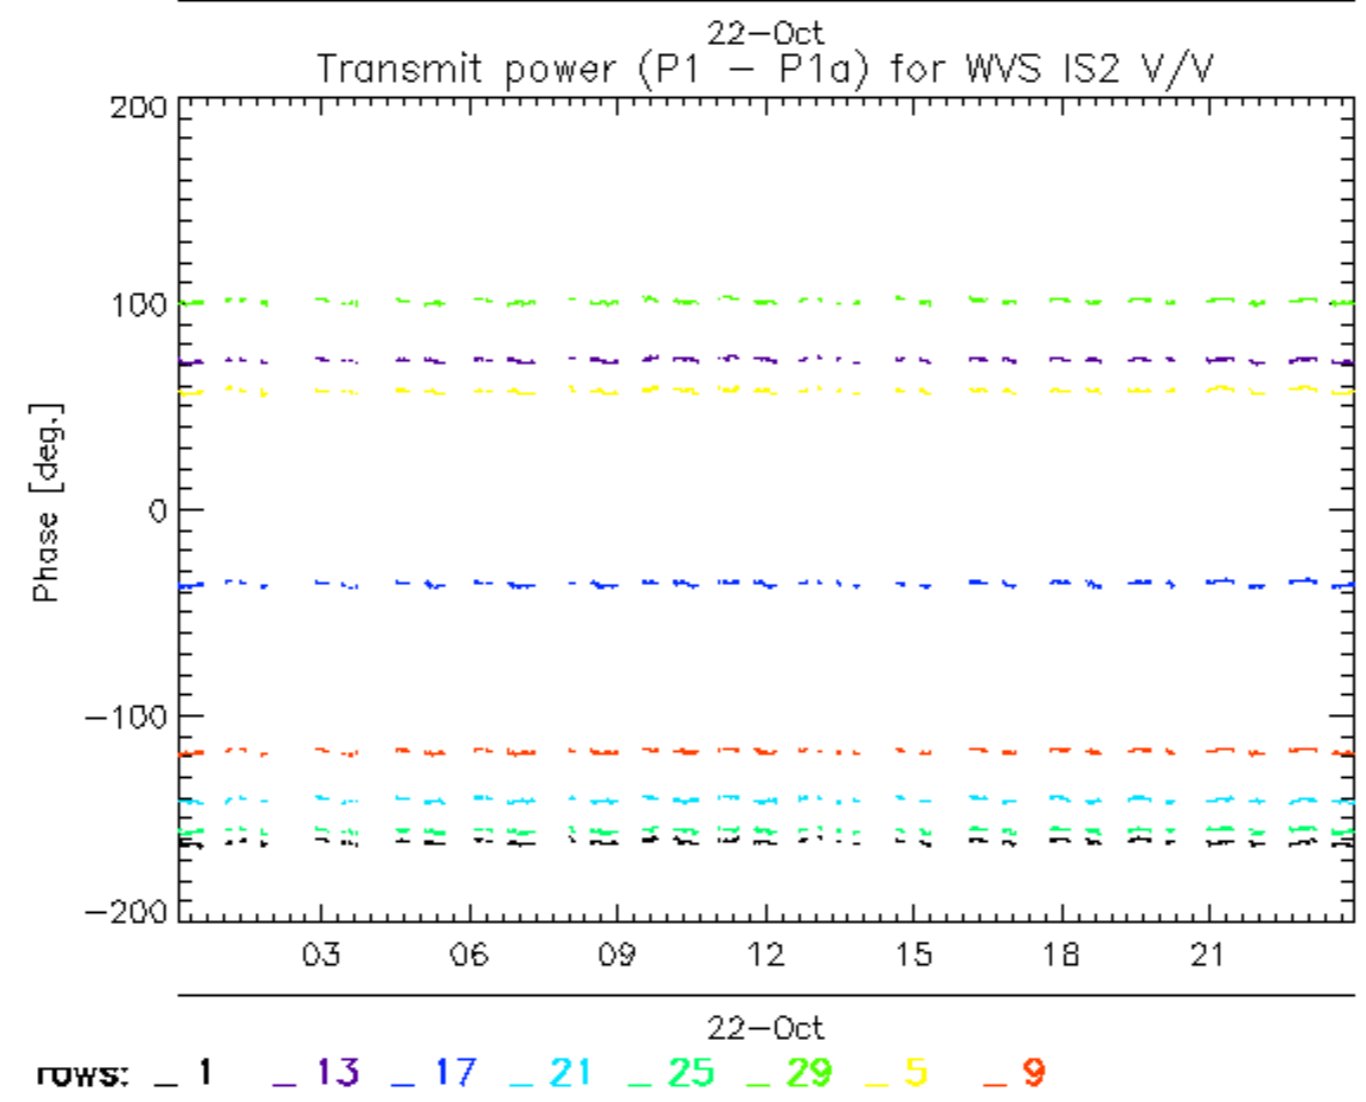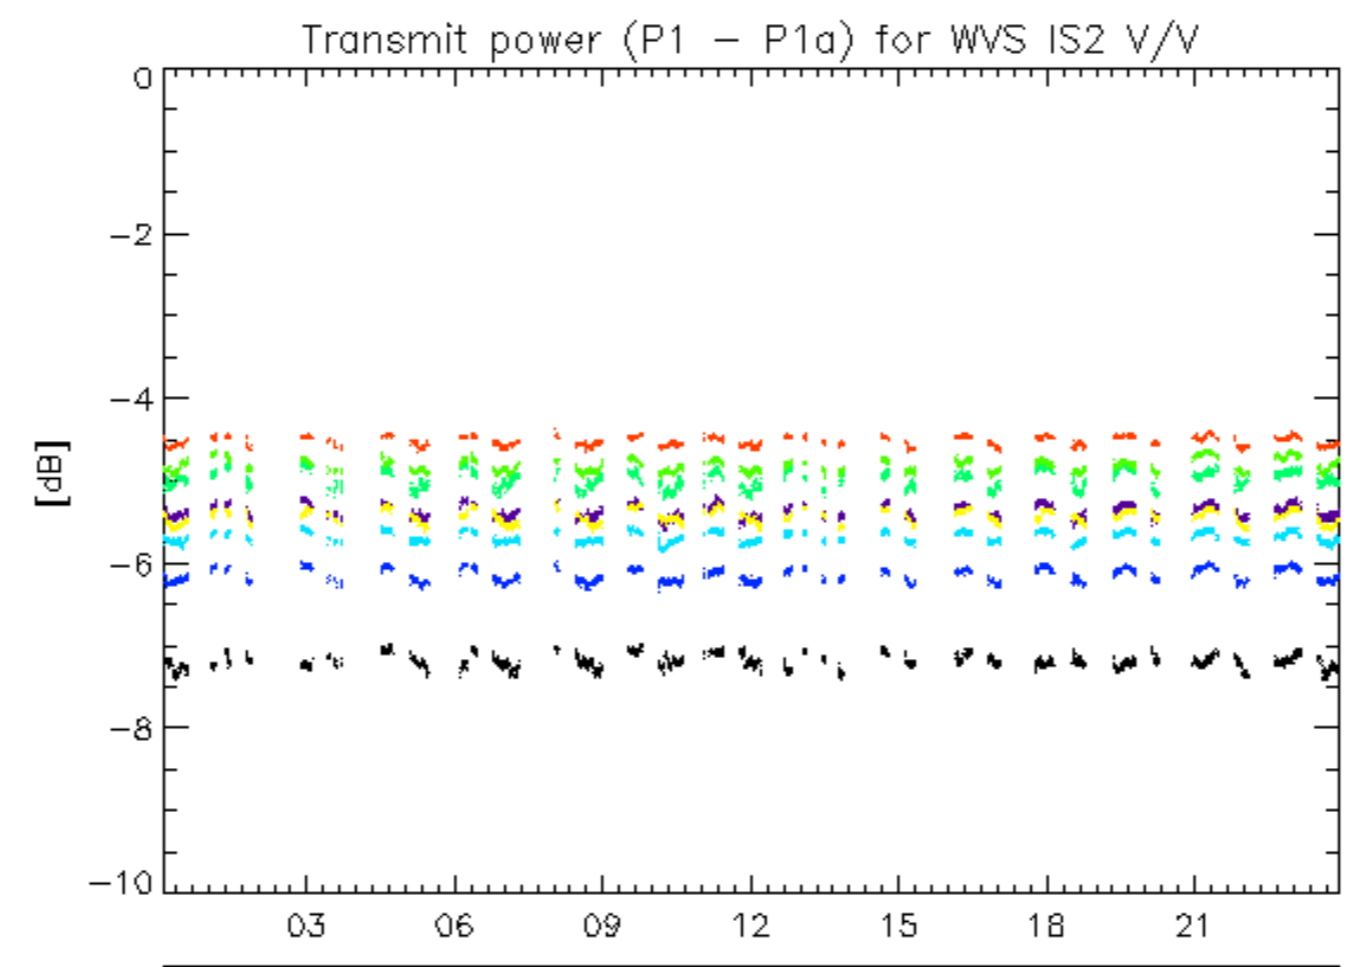

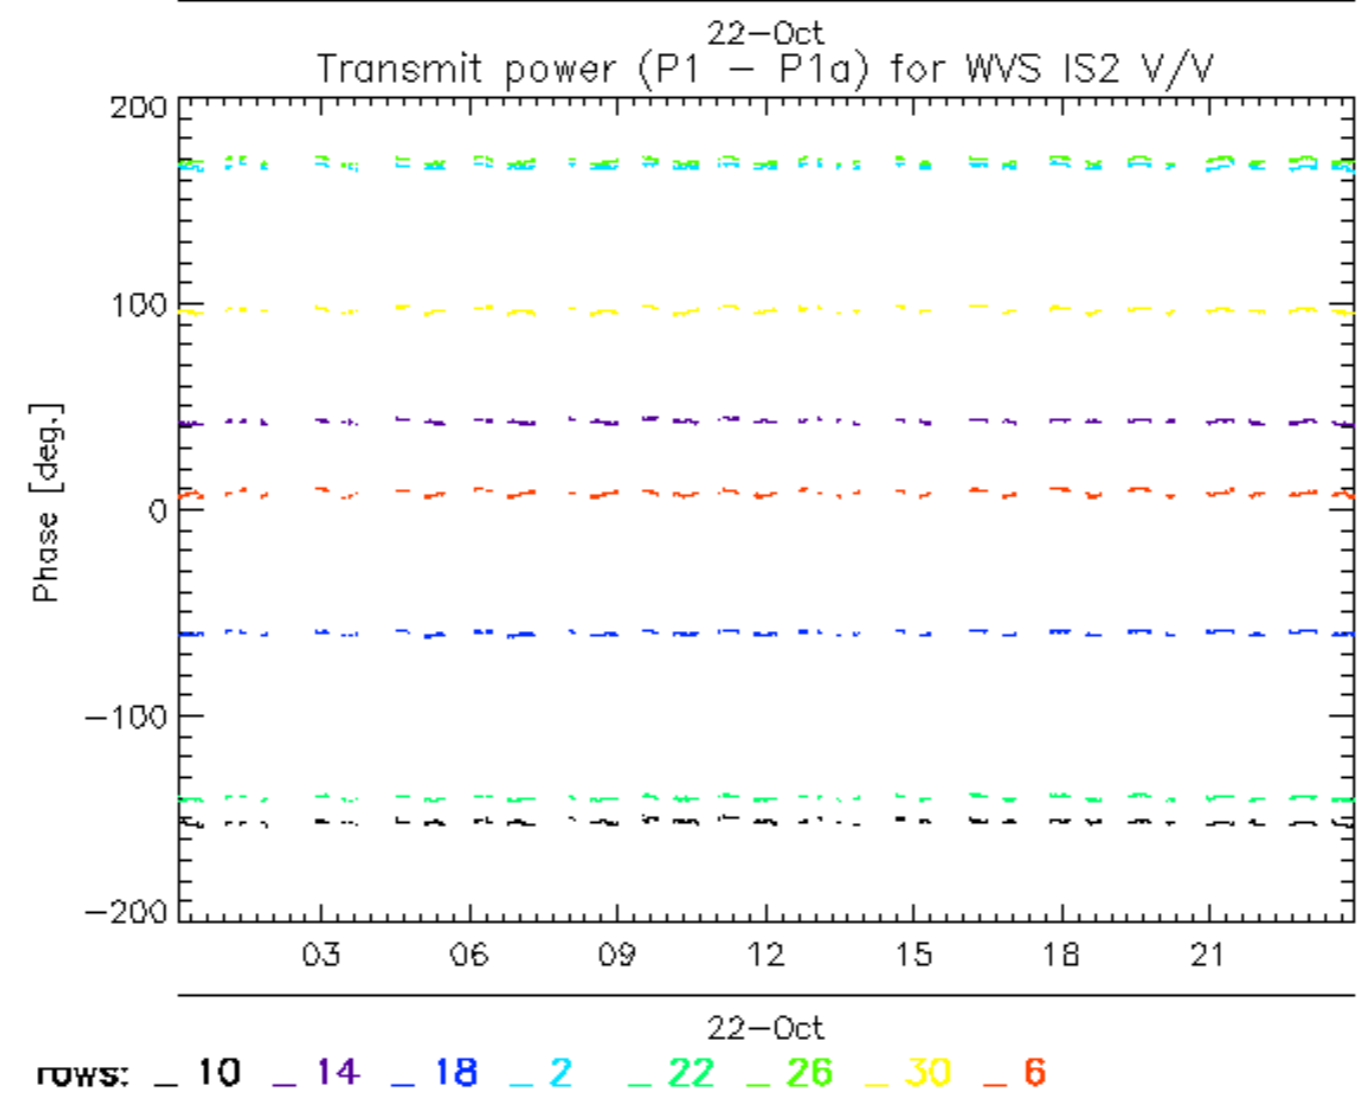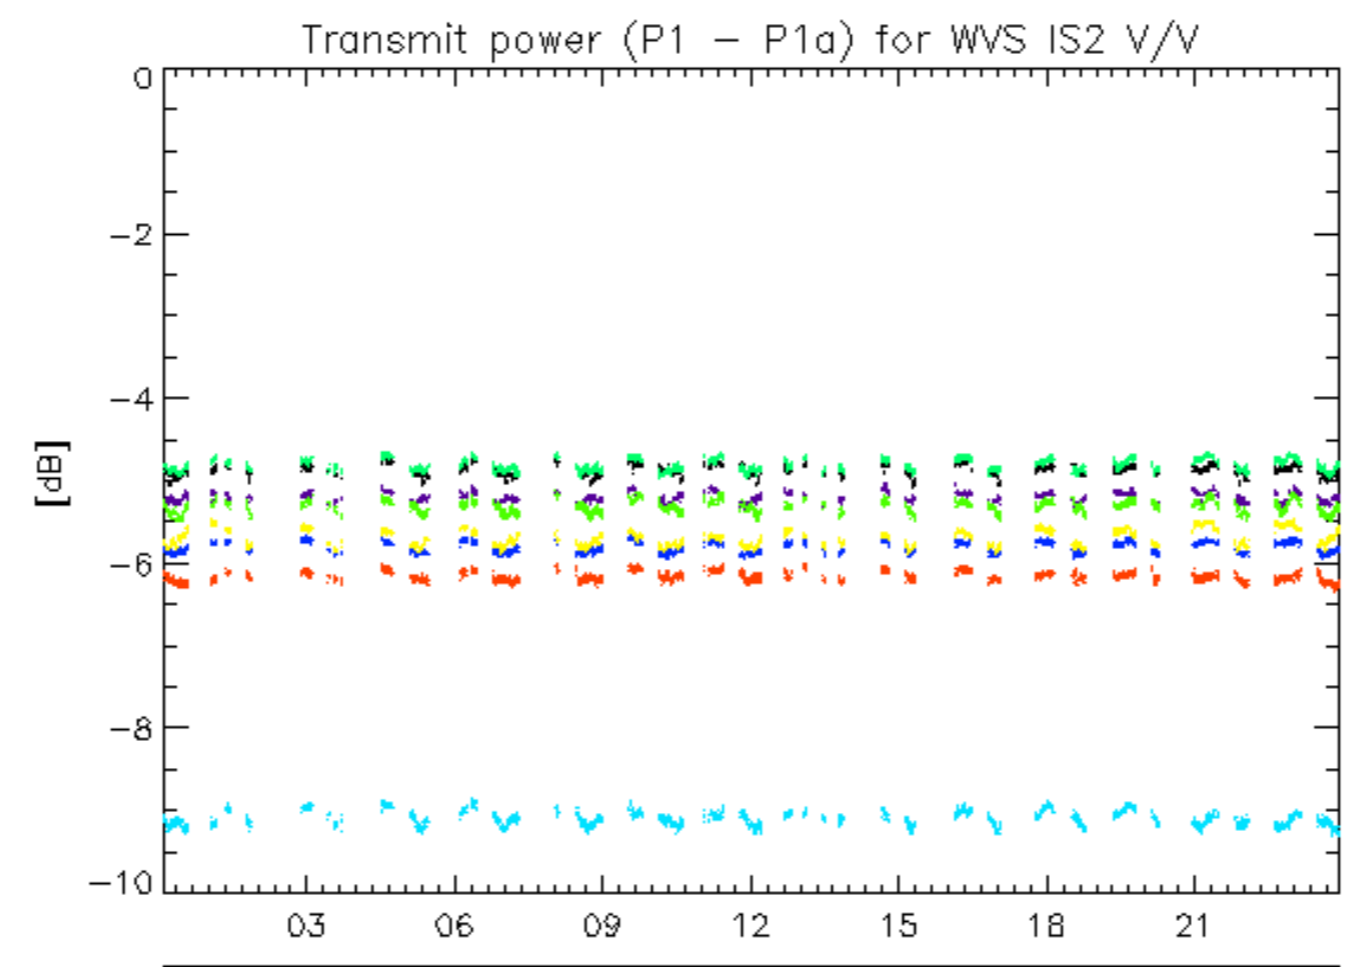


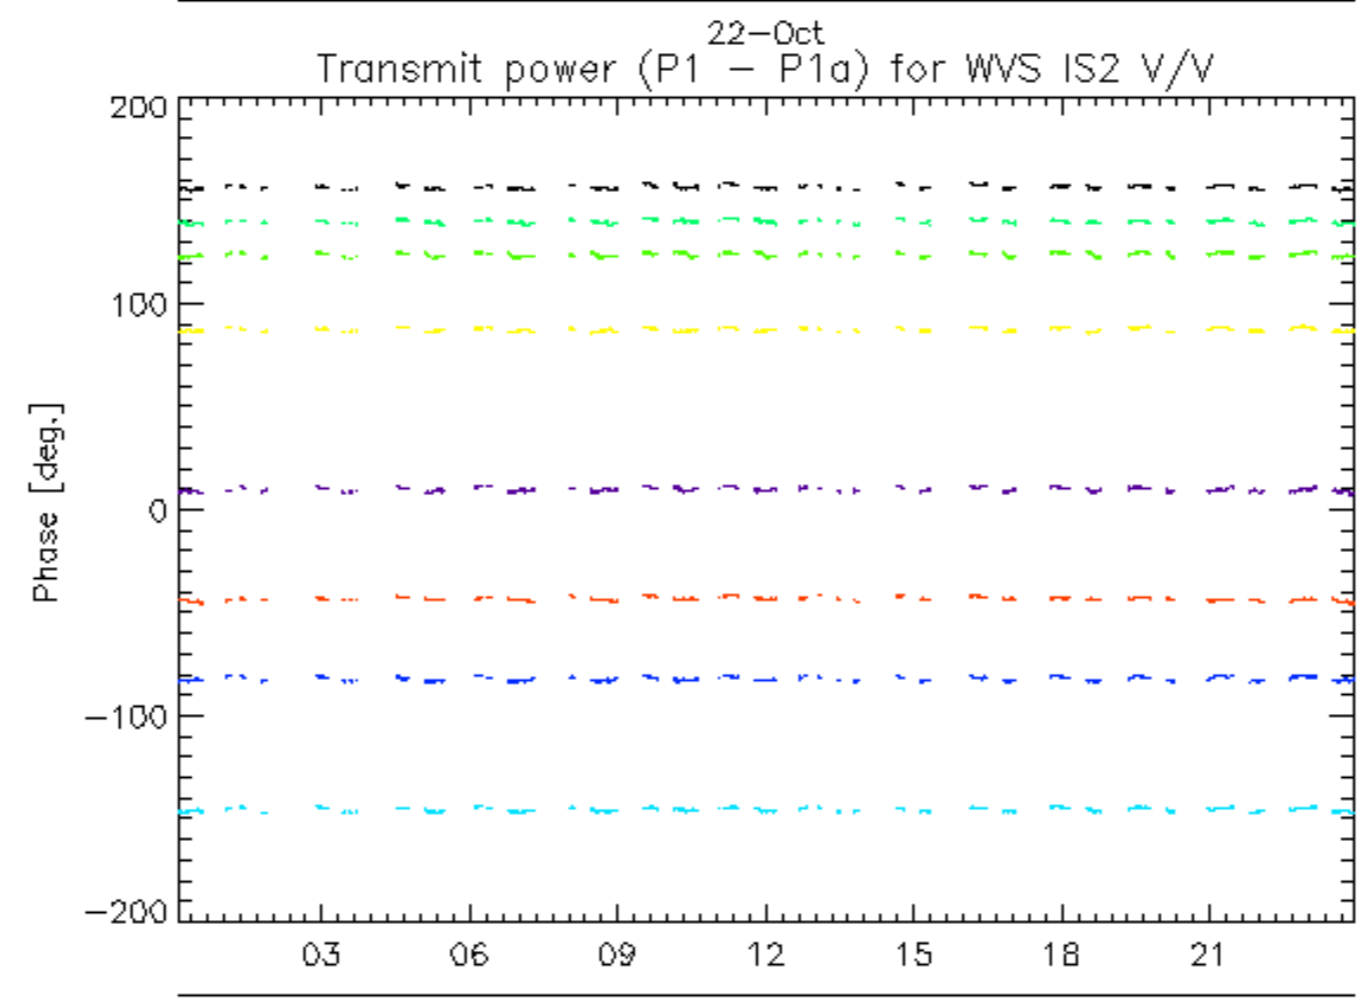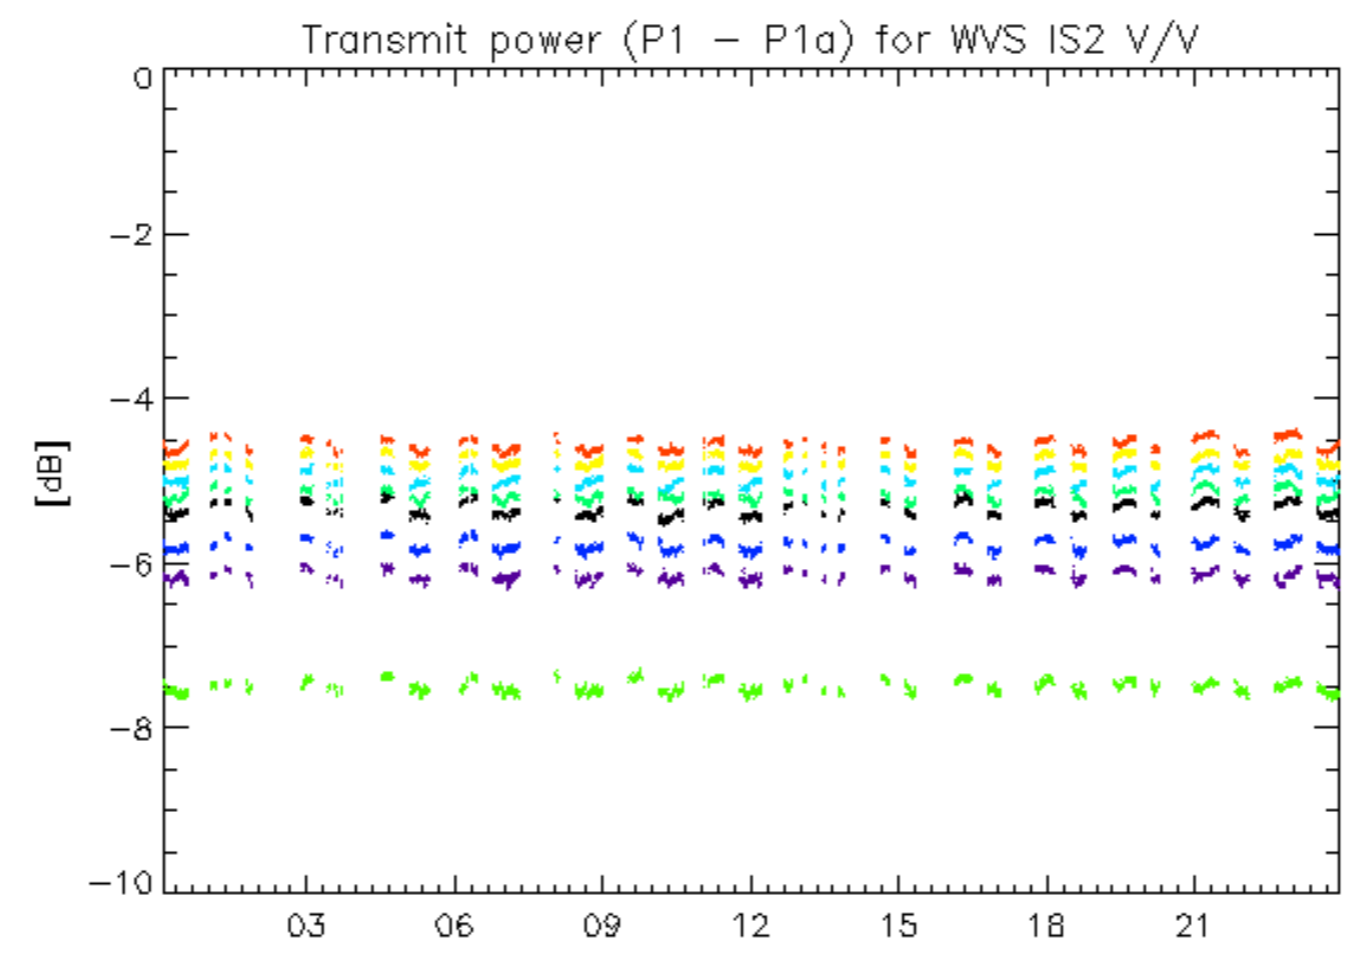



rows: _ 11 _ 15 _ 19 _ 23 _ 27 _ 31 _ 7

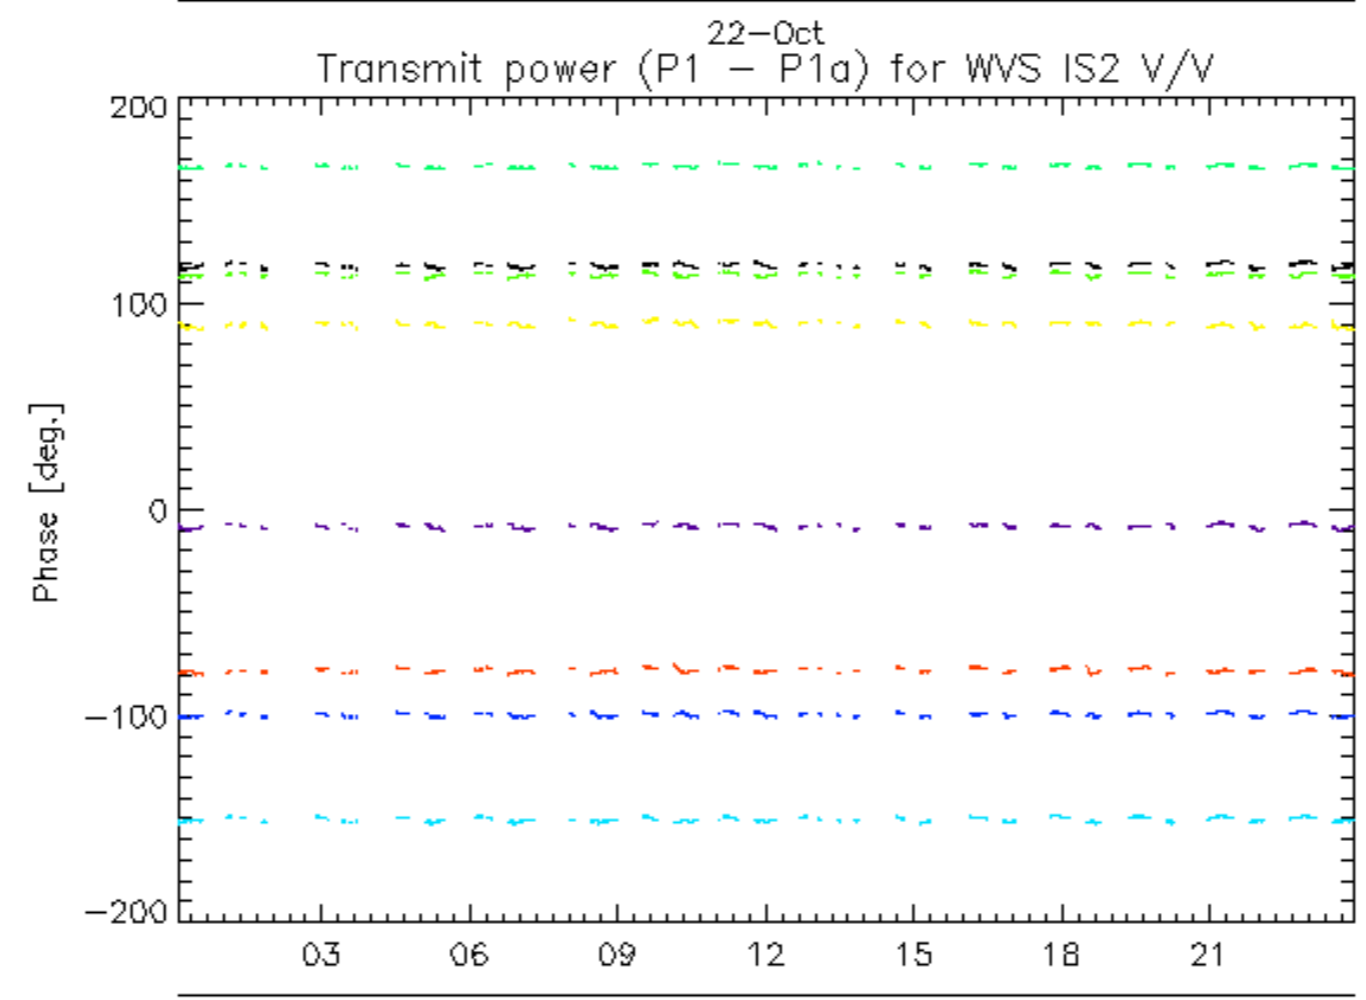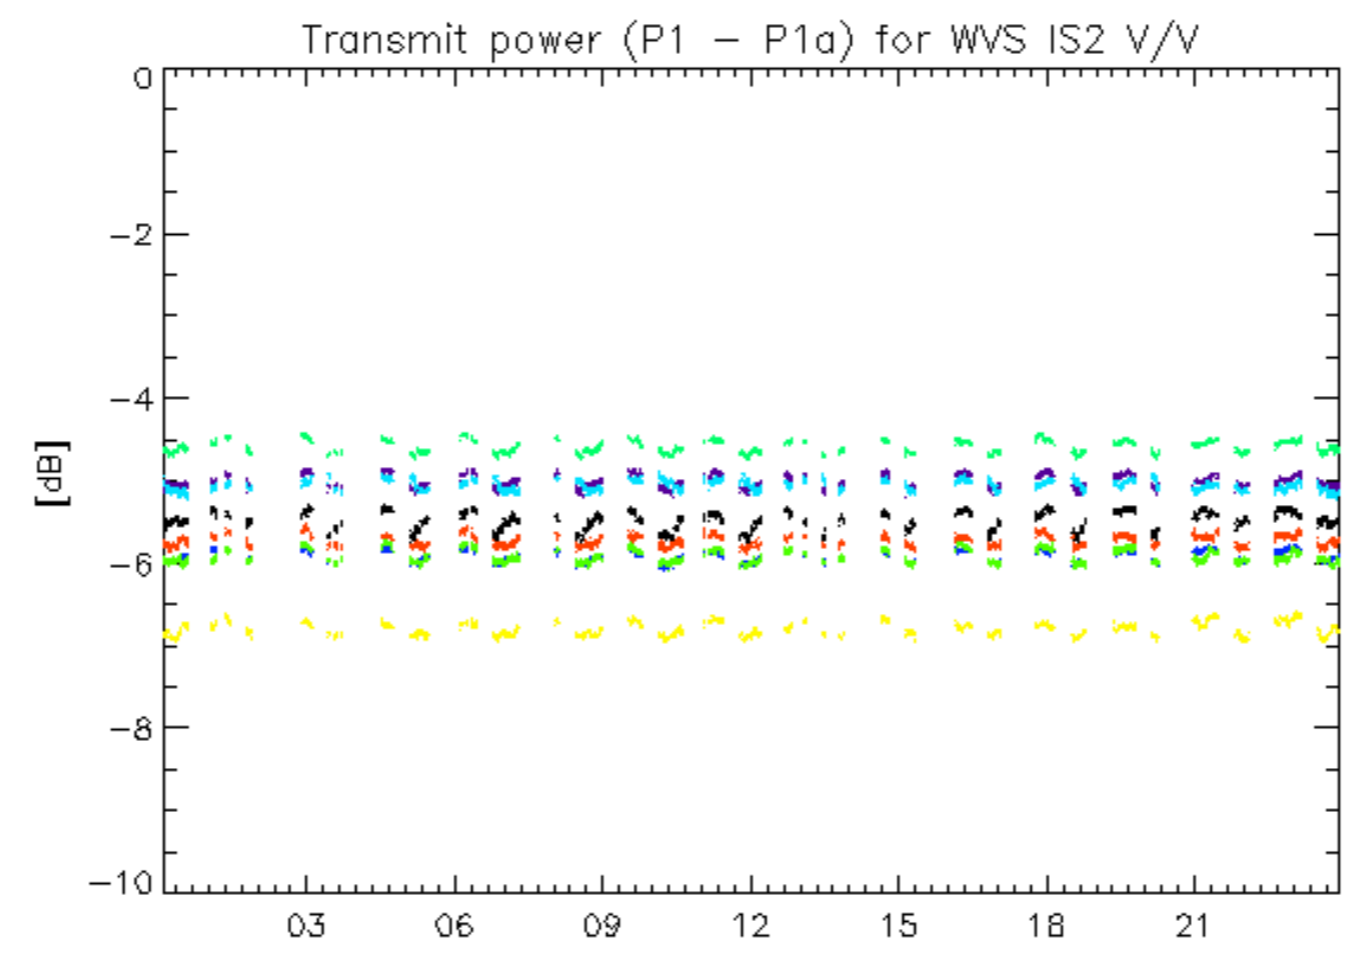


rows: _ 12 _ 16 _ 20 _ 24 _ 28 _ 32 _ 4 _ 8

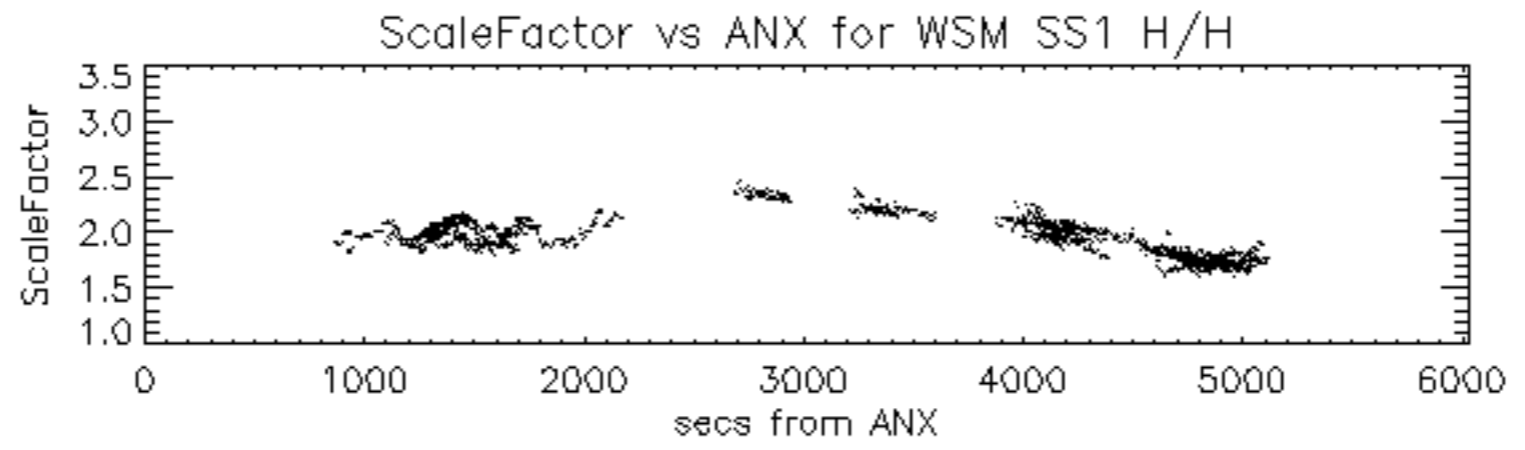

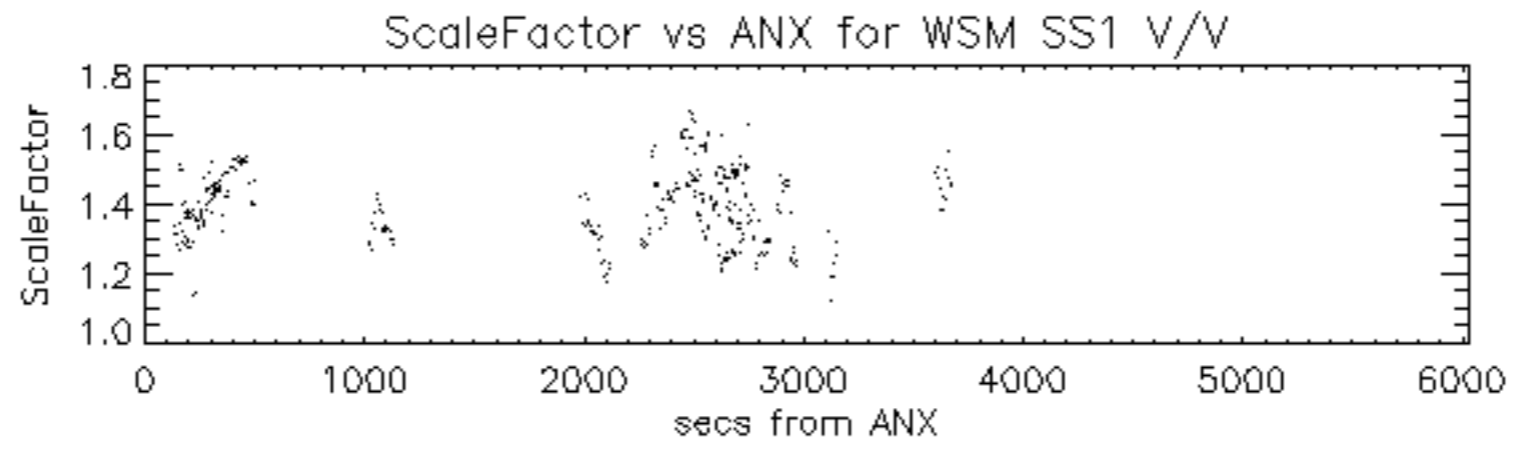

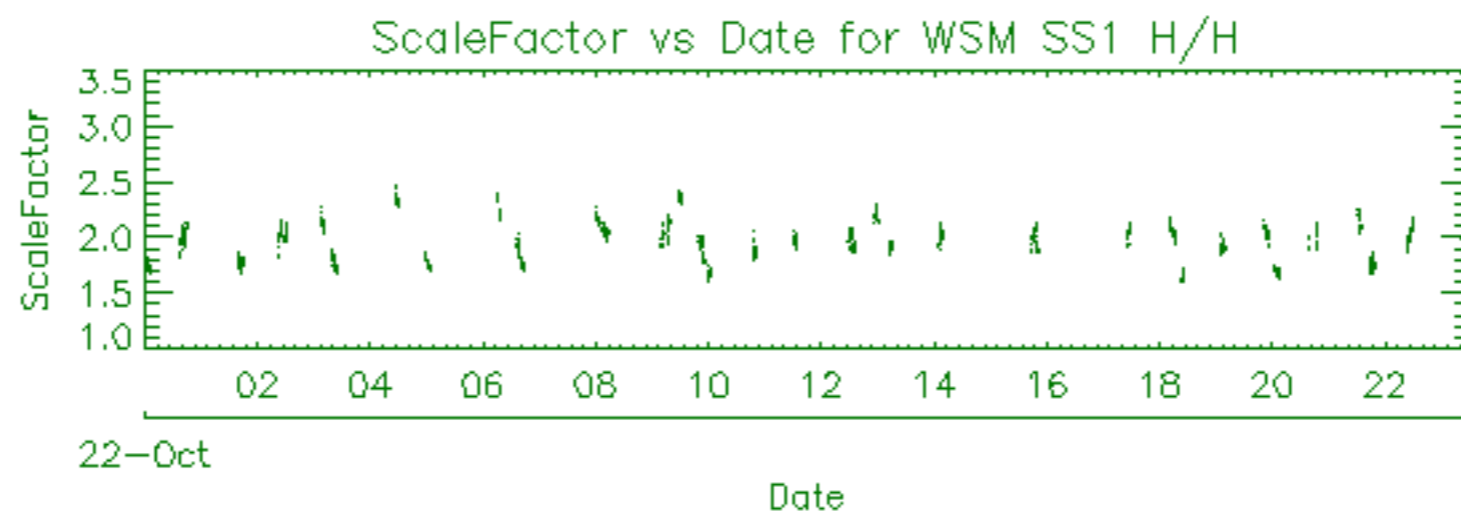

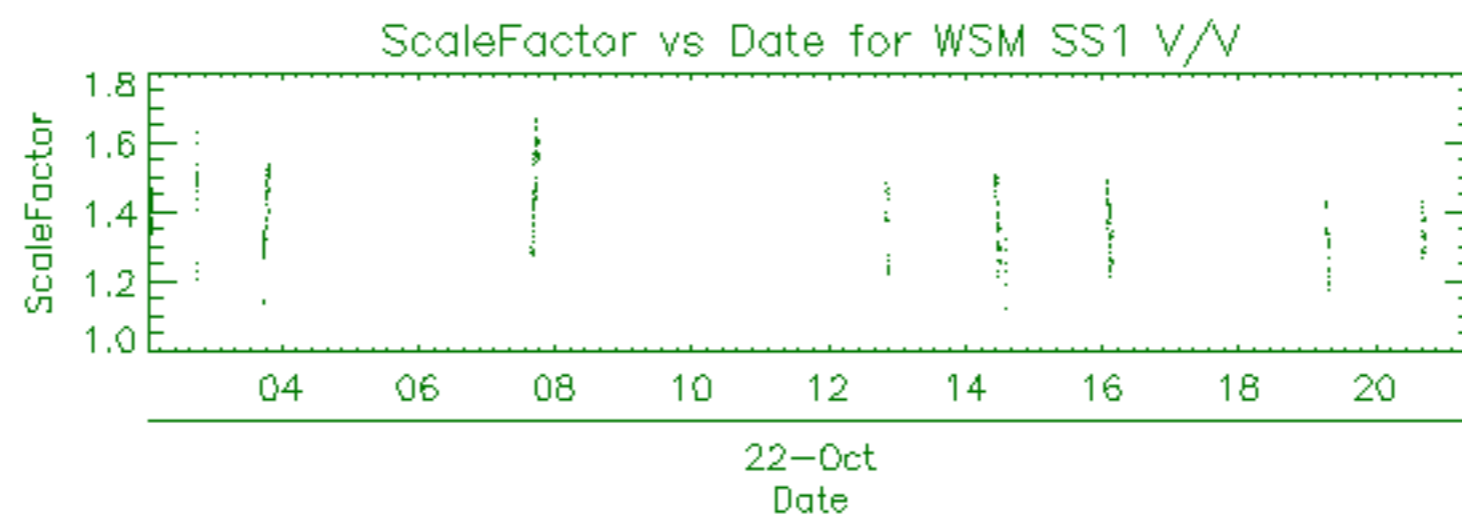

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_APM_1PNPDE20111022_024743_000000873107_00420_50434_1325.N1						IS4	H/H	107	50434	420	5.04
ASA_APM_1PNPDE20111022_075130_000000443107_00423_50437_1442.N1						IS4	V/H	107	50437	423	5.04
ASA_APM_1PNPDE20111022_075454_000000443107_00423_50437_1446.N1						IS4	V/H	107	50437	423	5.04
ASA_APM_1PNPDE20111022_092212_000000433107_00424_50438_1471.N1						IS7	H/H	107	50438	424	5.04
ASA_APM_1PNPDE20111022_152722_000000423107_00428_50442_1538.N1						IS2	H/H	107	50442	428	5.04
ASA_APM_1PNPDE20111022_170511_000000443107_00429_50443_1544.N1						IS4	H/H	107	50443	429	5.04


ASA_GM1_1PNPDK20111022_173741_000002413107_00429_50443_4833.N1	SS1	H/H	107	50443	429	5.04
ASA_GM1_1PNPDK20111022_180904_000001203107_00429_50443_4834.N1	SS1	H/H	107	50443	429	5.04
ASA_GM1_1PNPDK20111022_181744_000003263107_00429_50443_4836.N1	SS1	H/H	107	50443	429	5.04
ASA_GM1_1PNPDK20111022_184736_000008103107_00430_50444_4838.N1	SS1	H/H	107	50444	430	5.04
ASA_GM1_1PNPDK20111022_185951_000002773107_00430_50444_4853.N1	SS1	H/H	107	50444	430	5.04
ASA_GM1_1PNPDK20111022_191036_000002233107_00430_50444_4854.N1	SS1	H/H	107	50444	430	5.04
ASA_GM1_1PNPDK20111022_195705_000003143107_00430_50444_4857.N1	SS1	H/H	107	50444	430	5.04
ASA_GM1_1PNPDK20111022_201639_000012993107_00430_50444_4859.N1	SS1	H/H	107	50444	430	5.04
ASA_GM1_1PNPDE20111022_204312_000001383107_00431_50445_1565.N1	SS1	H/H	107	50445	431	5.04
ASA_GM1_1PNPDE20111022_212929_000000663107_00431_50445_1572.N1	SS1	H/H	107	50445	431	5.04
ASA_GM1_1PNPDE20111022_213435_000005013107_00431_50445_1571.N1	SS1	H/H	107	50445	431	5.04
ASA_GM1_1PNPDE20111022_220531_000005793108_00001_50446_1579.N1	SS1	H/H	108	50446	1	5.04
ASA_GM1_1PNPDE20111022_222946_000004223108_00001_50446_1584.N1	SS1	H/H	108	50446	1	5.04
ASA_GM1_1PNPDE20111022_230944_000000783108_00001_50446_1583.N1	SS1	H/H	108	50446	1	5.04
ASA_GM1_1PNPDE20111022_231228_000005373108_00001_50446_1595.N1	SS1	H/H	108	50446	1	5.04


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20111022_033056_000000523107_00420_50434_1358.N1						IS6	H/H	107	50434	420	5.04
ASA_IMM_1PNPDE20111022_041951_000002433107_00421_50435_1359.N1						IS6	H/H	107	50435	421	5.04
ASA_IMM_1PNPDE20111022_055902_000003393107_00422_50436_1402.N1						IS6	H/H	107	50436	422	5.04
ASA_IMM_1PNPDE20111022_091954_000000693107_00424_50438_1468.N1						IS6	H/H	107	50438	424	5.04
ASA_IMM_1PNPDE20111022_114922_000000523107_00425_50439_1520.N1						IS6	H/H	107	50439	425	5.04
ASA_IMM_1PNPDE20111022_152636_000000373107_00428_50442_1539.N1						IS2	H/H	107	50442	428	5.04
ASA_IMM_1PNPDE20111022_174140_000001123107_00429_50443_1555.N1						IS6	H/H	107	50443	429	5.04
ASA_IMM_1PNPDE20111022_174351_000000423107_00429_50443_1554.N1						IS2	V/V	107	50443	429	5.04


Filename	Pol	Timestamp	count(Module)
ASA_MS__0PNPDE20111022_044837_000000163107_00421_50435_0405.N1	H	2011-10-22 04:48:37	320
ASA_MS__0PNPDK20111022_062851_000000163107_00422_50436_0846.N1	V	2011-10-22 06:28:51	320
ASA_MS__0PNPDE20111022_231110_000000163108_00001_50446_0406.N1	H	2011-10-22 23:11:10	320


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WSM_1PNPDE20111021_235919_000003923107_00418_50432_1264.N1						SS1	H/H	107	50432	418	5.04
ASA_WSM_1PNPDE20111022_003623_000005693107_00419_50433_1298.N1						SS1	H/H	107	50433	419	5.04
ASA_WSM_1PNPDE20111022_003623_000005693107_00419_50433_1299.N1						SS1	H/H	107	50433	419	5.04
ASA_WSM_1PNPDE20111022_003623_000005693107_00419_50433_1303.N1						SS1	H/H	107	50433	419	5.04
ASA_WSM_1PNPDE20111022_013920_000003923107_00419_50433_1297.N1						SS1	H/H	107	50433	419	5.04
ASA_WSM_1PNPDK20111022_020326_000002453107_00420_50434_4572.N1						SS1	V/V	107	50434	420	5.04
ASA_WSM_1PNPDE20111022_022209_000002143107_00420_50434_1327.N1						SS1	H/H	107	50434	420	5.04
ASA_WSM_1PNPDE20111022_022809_000002143107_00420_50434_1329.N1						SS1	H/H	107	50434	420	5.04
ASA_WSM_1PNPDE20111022_024453_000001593107_00420_50434_1326.N1						SS1	V/V	107	50434	420	5.04
ASA_WSM_1PNPDE20111022_030719_000002083107_00420_50434_1341.N1						SS1	H/H	107	50434	420	5.04
ASA_WSM_1PNPDE20111022_031811_000003923107_00420_50434_1357.N1						SS1	H/H	107	50434	420	5.04
ASA_WSM_1PNPDK20111022_034345_000003923107_00421_50435_4588.N1						SS1	V/V	107	50435	421	5.04
ASA_WSM_1PNPDE20111022_042616_000002753107_00421_50435_1360.N1						SS1	H/H	107	50435	421	5.04
ASA_WSM_1PNPDE20111022_045713_000003923107_00421_50435_1401.N1						SS1	H/H	107	50435	421	5.04
ASA_WSM_1PNPDE20111022_061531_000002083107_00422_50436_1406.N1						SS1	H/H	107	50436	422	5.04
ASA_WSM_1PNPDK20111022_063533_000005143107_00422_50436_4624.N1						SS1	H/H	107	50436	422	5.04
ASA_WSM_1PNPDE20111022_073939_000003303107_00423_50437_1443.N1						SS1	V/V	107	50437	423	5.04
ASA_WSM_1PNPDE20111022_075855_000002083107_00423_50437_1447.N1						SS1	H/H	107	50437	423	5.04
ASA_WSM_1PNPDK20111022_080638_000004103107_00423_50437_4657.N1						SS1	H/H	107	50437	423	5.04
ASA_WSM_1PNPDE20111022_090904_000001533107_00424_50438_1464.N1						SS1	H/H	107	50438	424	5.04
ASA_WSM_1PNPDE20111022_091513_000002203107_00424_50438_1467.N1						SS1	H/H	107	50438	424	5.04
ASA_WSM_1PNPDE20111022_092755_000002143107_00424_50438_1472.N1						SS1	H/H	107	50438	424	5.04
ASA_WSM_1PNPDE20111022_094857_000004163107_00424_50438_1505.N1						SS1	H/H	107	50438	424	5.04
ASA_WSM_1PNPDE20111022_095859_000002513107_00424_50438_1506.N1						SS1	H/H	107	50438	424	5.04
ASA_WSM_1PNPDK20111022_104614_000003003107_00425_50439_4688.N1						SS1	H/H	107	50439	425	5.04
ASA_WSM_1PNPDE20111022_113020_000002513107_00425_50439_1507.N1						SS1	H/H	107	50439	425	5.04
ASA_WSM_1PNPDK20111022_122821_000004533107_00426_50440_4727.N1						SS1	H/H	107	50440	426	5.04
ASA_WSM_1PNPDE20111022_125041_000001103107_00426_50440_1527.N1						SS1	V/V	107	50440	426	5.04
ASA_WSM_1PNPDE20111022_125613_000002453107_00426_50440_1528.N1						SS1	H/H	107	50440	426	5.04
ASA_WSM_1PNPDK20111022_131143_000001903107_00426_50440_4760.N1						SS1	H/H	107	50440	426	5.04
ASA_WSM_1PNPDK20111022_140447_000003123107_00427_50441_4759.N1						SS1	H/H	107	50441	427	5.04
ASA_WSM_1PNPDK20111022_142613_000002693107_00427_50441_4768.N1						SS1	V/V	107	50441	427	5.04
ASA_WSM_1PNPDE20111022_143448_000000613107_00427_50441_1536.N1						SS1	V/V	107	50441	427	5.04
ASA_WSM_1PNPDK20111022_154319_000004893107_00428_50442_4789.N1						SS1	H/H	107	50442	428	5.04
ASA_WSM_1PNPDK20111022_160418_000002693107_00428_50442_4796.N1						SS1	V/V	107	50442	428	5.04
ASA_WSM_1PNPDK20111022_172458_000002513107_00429_50443_4816.N1						SS1	H/H	107	50443	429	5.04
ASA_WSM_1PNPDE20111022_181110_000003733107_00429_50443_1556.N1						SS1	H/H	107	50443	429	5.04
ASA_WSM_1PNPDE20111022_182314_000001903107_00429_50443_1553.N1						SS1	H/H	107	50443	429	5.04
ASA_WSM_1PNPDK20111022_190429_000001533107_00430_50444_4844.N1						SS1	H/H	107	50444	430	5.04
ASA_WSM_1PNPDE20111022_190626_000002453107_00430_50444_1560.N1						SS1	H/H	107	50444	430	5.04
ASA_WSM_1PNPDE20111022_191646_000001533107_00430_50444_1563.N1						SS1	V/V	107	50444	430	5.04
ASA_WSM_1PNPDE20111022_195028_000003923107_00430_50444_1564.N1						SS1	H/H	107	50444	430	5.04
ASA_WSM_1PNPDE20111022_200220_000003303107_00430_50444_1562.N1						SS1	H/H	107	50444	430	5.04
ASA_WSM_1PNPDK20111022_203820_000000923107_00431_50445_4858.N1						SS1	H/H	107	50445	431	5.04
ASA_WSM_1PNPDK20111022_204052_000001353107_00431_50445_4867.N1						SS1	V/V	107	50445	431	5.04
ASA_WSM_1PNPDK20111022_204536_000001843107_00431_50445_4869.N1						SS1	H/H	107	50445	431	5.04
ASA_WSM_1PNPDE20111022_212355_000000923107_00431_50445_1580.N1						SS1	V/V	107	50445	431	5.04
ASA_WSM_1PNPDE20111022_213046_000002263107_00431_50445_1585.N1						SS1	H/H	107	50445	431	5.04
ASA_WSM_1PNPDE20111022_214259_000003923107_00431_50445_1566.N1						SS1	H/H	107	50445	431	5.04
ASA_WSM_1PNPDK20111022_222212_000002083108_00001_50446_4885.N1						SS1	H/H	108	50446	1	5.04
ASA_WSM_1PNPDE20111022_222612_000002083108_00001_50446_1586.N1						SS1	H/H	108	50446	1	5.04
ASA_WSM_1PNPDE20111022_222612_000002083108_00001_50446_1588.N1						SS1	H/H	108	50446	1	5.04
ASA_WSM_1PNPDE20111022_232130_000004593108_00001_50446_1582.N1						SS1	H/H	108	50446	1	5.04




Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20111022_000551_000002703107_00418_50432_1274.N1						IS2	V/V	107	50432	418	5.04
ASA_WVS_1PNPDE20111022_000936_000015593107_00418_50432_1309.N1						IS2	V/V	107	50432	418	5.04
ASA_WVS_1PNPDE20111022_010214_000004873107_00419_50433_1302.N1						IS2	V/V	107	50433	419	5.04
ASA_WVS_1PNPDE20111022_012112_000002853107_00419_50433_1301.N1						IS2	V/V	107	50433	419	5.04
ASA_WVS_1PNPDE20111022_014552_000000893107_00419_50433_1308.N1						IS2	V/V	107	50433	419	5.04
ASA_WVS_1PNPDE20111022_014622_000003453107_00419_50433_1342.N1						IS2	V/V	107	50433	419	5.04
ASA_WVS_1PNPDE20111022_014622_000003453107_00419_50433_1333.N1						IS2	V/V	107	50433	419	5.04
ASA_WVS_1PNPDE20111022_014552_000000893107_00419_50433_1308.N1						IS1	V/V	107	50433	419	5.04
ASA_WVS_1PNPDE20111022_025321_000004793107_00420_50434_1334.N1						IS2	V/V	107	50434	420	5.04
ASA_WVS_1PNPDE20111022_030106_000003003107_00420_50434_1363.N1						IS2	V/V	107	50434	420	5.04
ASA_WVS_1PNPDE20111022_032546_000000603107_00420_50434_1361.N1						IS2	V/V	107	50434	420	5.04
ASA_WVS_1PNPDE20111022_033328_000001493107_00420_50434_1366.N1						IS2	V/V	107	50434	420	5.04
ASA_WVS_1PNPDE20111022_034146_000000743107_00421_50435_1370.N1						IS2	V/V	107	50435	421	5.04
ASA_WVS_1PNPDE20111022_034146_000000743107_00421_50435_1375.N1						IS2	V/V	107	50435	421	5.04
ASA_WVS_1PNPDE20111022_043051_000007353107_00421_50435_1369.N1						IS2	V/V	107	50435	421	5.04
ASA_WVS_1PNPDE20111022_043051_000007353107_00421_50435_1374.N1						IS2	V/V	107	50435	421	5.04
ASA_WVS_1PNPDE20111022_044236_000000903107_00421_50435_1404.N1						IS2	V/V	107	50435	421	5.04
ASA_WVS_1PNPDE20111022_043051_000007353107_00421_50435_1374.N1						IS1	V/V	107	50435	421	5.04
ASA_WVS_1PNPDE20111022_043051_000007353107_00421_50435_1369.N1						IS1	V/V	107	50435	421	5.04
ASA_WVS_1PNPDE20111022_050609_000012893107_00421_50435_1416.N1						IS2	V/V	107	50435	421	5.04
ASA_WVS_1PNPDE20111022_060641_000004943107_00422_50436_1415.N1						IS2	V/V	107	50436	422	5.04
ASA_WVS_1PNPDE20111022_061909_000002103107_00422_50436_1418.N1						IS2	V/V	107	50436	422	5.04
ASA_WVS_1PNPDK20111022_062209_000002703107_00422_50436_4607.N1						IS2	V/V	107	50436	422	5.04
ASA_WVS_1PNPDE20111022_061909_000002103107_00422_50436_1418.N1						IS1	V/V	107	50436	422	5.04
ASA_WVS_1PNPDK20111022_064623_000018743107_00422_50436_4610.N1						IS2	V/V	107	50436	422	5.04
ASA_WVS_1PNPDK20111022_080225_000002103107_00423_50437_4646.N1						IS2	V/V	107	50437	423	5.04
ASA_WVS_1PNPDK20111022_082637_000019643107_00423_50437_4649.N1						IS2	V/V	107	50437	423	5.04
ASA_WVS_1PNPDK20111022_093130_000009443107_00424_50438_4679.N1						IS2	V/V	107	50438	424	5.04
ASA_WVS_1PNPDK20111022_100651_000018443107_00424_50438_4682.N1						IS2	V/V	107	50438	424	5.04
ASA_WVS_1PNPDK20111022_110255_000000593107_00425_50439_4707.N1						IS2	V/V	107	50439	425	5.04
ASA_WVS_1PNPDK20111022_110916_000010793107_00425_50439_4710.N1						IS2	V/V	107	50439	425	5.04
ASA_WVS_1PNPDK20111022_114705_000001053107_00425_50439_4711.N1						IS2	V/V	107	50439	425	5.04
ASA_WVS_1PNPDK20111022_115020_000013793107_00425_50439_4713.N1						IS2	V/V	107	50439	425	5.04
ASA_WVS_1PNPDK20111022_115020_000013793107_00425_50439_4715.N1						IS2	V/V	107	50439	425	5.04
ASA_WVS_1PNPDK20111022_124015_000005843107_00426_50440_4739.N1						IS2	V/V	107	50440	426	5.04
ASA_WVS_1PNPDK20111022_130402_000002103107_00426_50440_4746.N1						IS2	V/V	107	50440	426	5.04
ASA_WVS_1PNPDK20111022_132719_000002103107_00426_50440_4747.N1						IS2	V/V	107	50440	426	5.04
ASA_WVS_1PNPDK20111022_134641_000003413107_00427_50441_4751.N1						IS2	V/V	107	50441	427	5.04
ASA_WVS_1PNPDK20111022_143754_000006003107_00427_50441_4773.N1						IS2	V/V	107	50441	427	5.04
ASA_WVS_1PNPDK20111022_150733_000007353107_00427_50441_4776.N1						IS2	V/V	107	50441	427	5.04
ASA_WVS_1PNPDK20111022_160909_000011393107_00428_50442_4805.N1						IS2	V/V	107	50442	428	5.04
ASA_WVS_1PNPDK20111022_164747_000010043107_00428_50442_4807.N1						IS2	V/V	107	50442	428	5.04
ASA_WVS_1PNPDK20111022_174513_000013793107_00429_50443_4835.N1						IS2	V/V	107	50443	429	5.04
ASA_WVS_1PNPDK20111022_183057_000009593107_00429_50443_4837.N1						IS2	V/V	107	50443	429	5.04
ASA_WVS_1PNPDK20111022_192033_000016793107_00430_50444_4855.N1						IS2	V/V	107	50444	430	5.04
ASA_WVS_1PNPDK20111022_200806_000004653107_00430_50444_4860.N1						IS2	V/V	107	50444	430	5.04
ASA_WVS_1PNPDK20111022_200806_000004653107_00430_50444_4861.N1						IS2	V/V	107	50444	430	5.04
ASA_WVS_1PNPDE20111022_205747_000015293107_00431_50445_1574.N1						IS2	V/V	107	50445	431	5.04
ASA_WVS_1PNPDE20111022_212614_000001503107_00431_50445_1570.N1						IS2	V/V	107	50445	431	5.04
ASA_WVS_1PNPDE20111022_214930_000001803107_00431_50445_1577.N1						IS2	V/V	107	50445	431	5.04
ASA_WVS_1PNPDE20111022_215145_000007793107_00431_50445_1581.N1						IS2	V/V	107	50445	431	5.04
ASA_WVS_1PNPDE20111022_223650_000019343108_00001_50446_1593.N1						IS2	V/V	108	50446	1	5.04
ASA_WVS_1PNPDE20111022_232909_000002103108_00001_50446_1589.N1						IS2	V/V	108	50446	1	5.04
ASA_WVS_1PNPDE20111022_233154_000014093108_00001_50446_1627.N1						IS2	V/V	108	50446	1	5.04



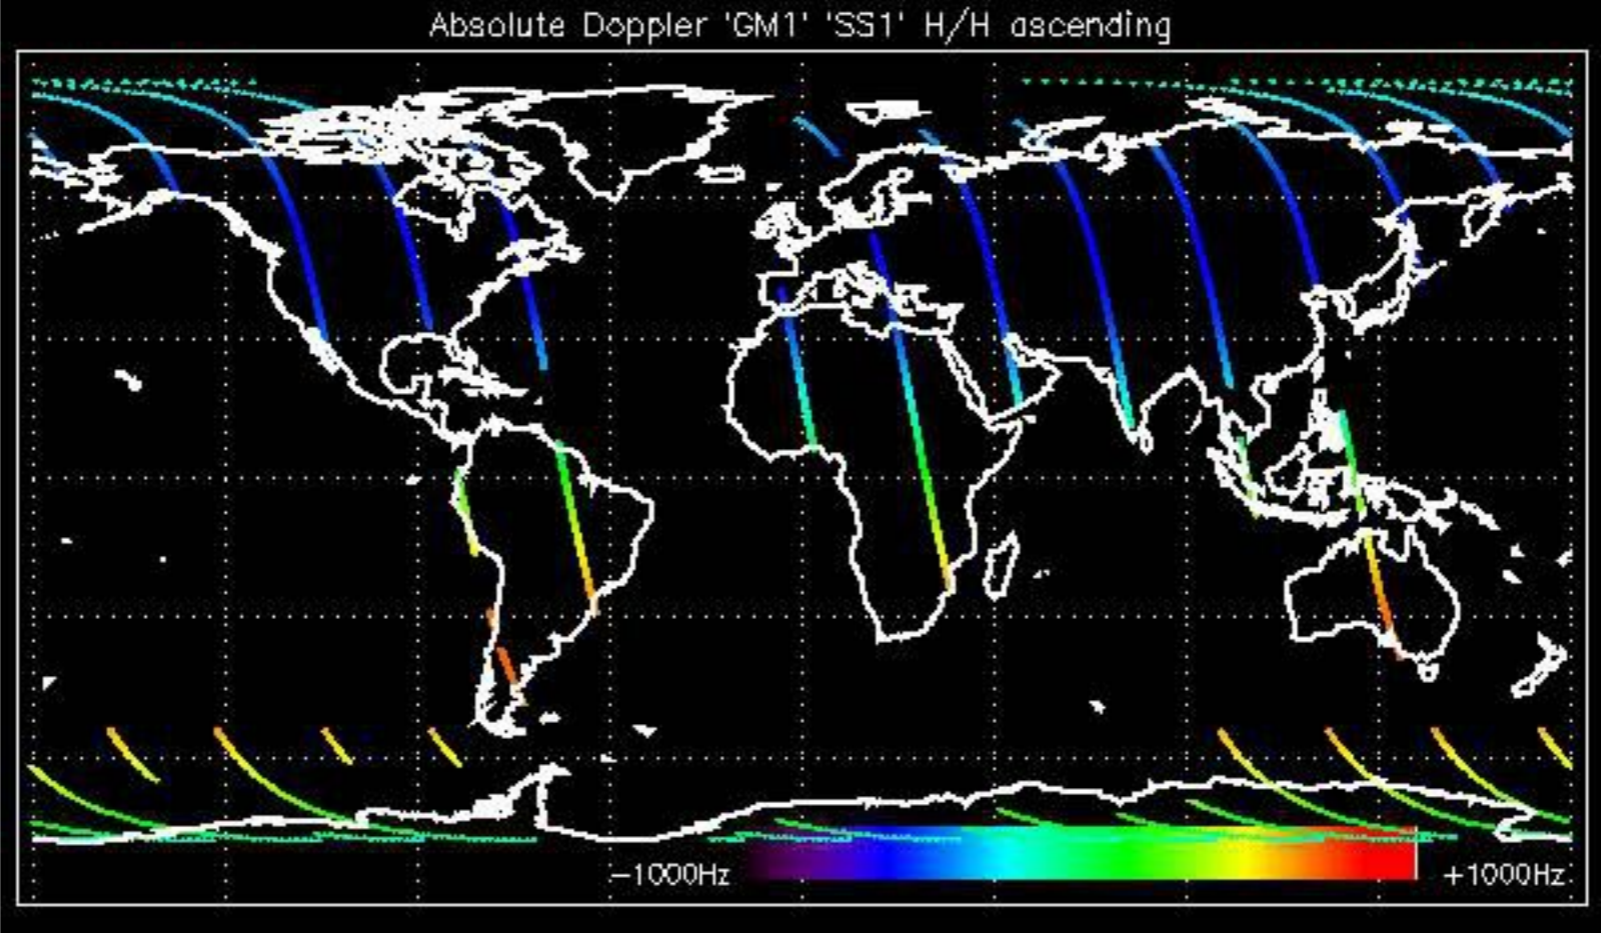


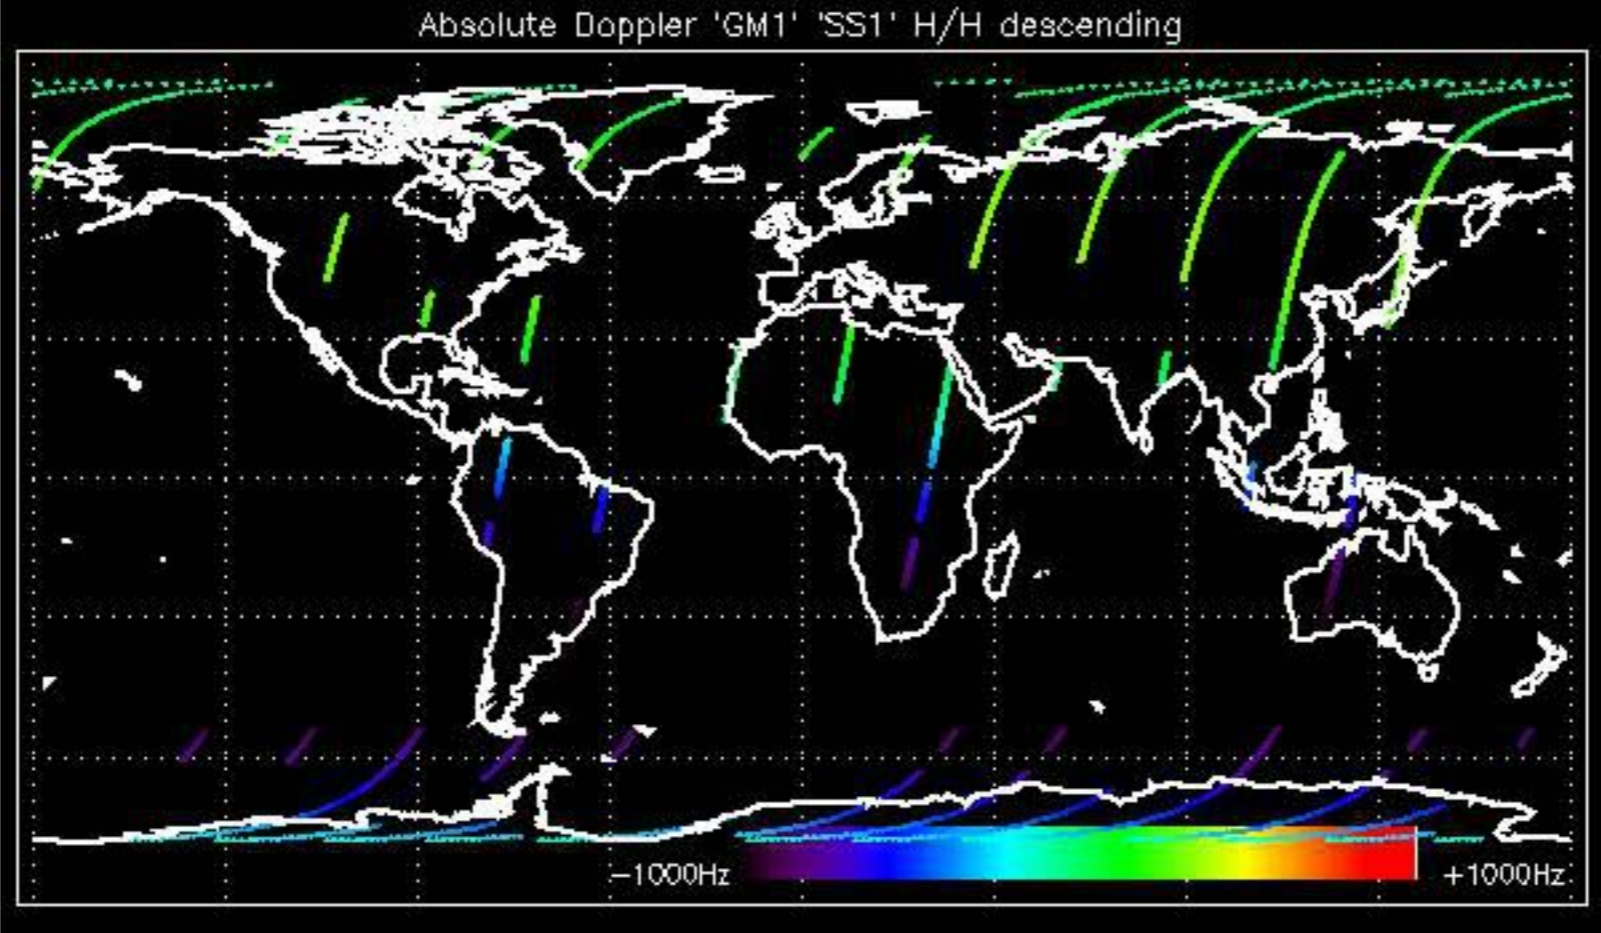


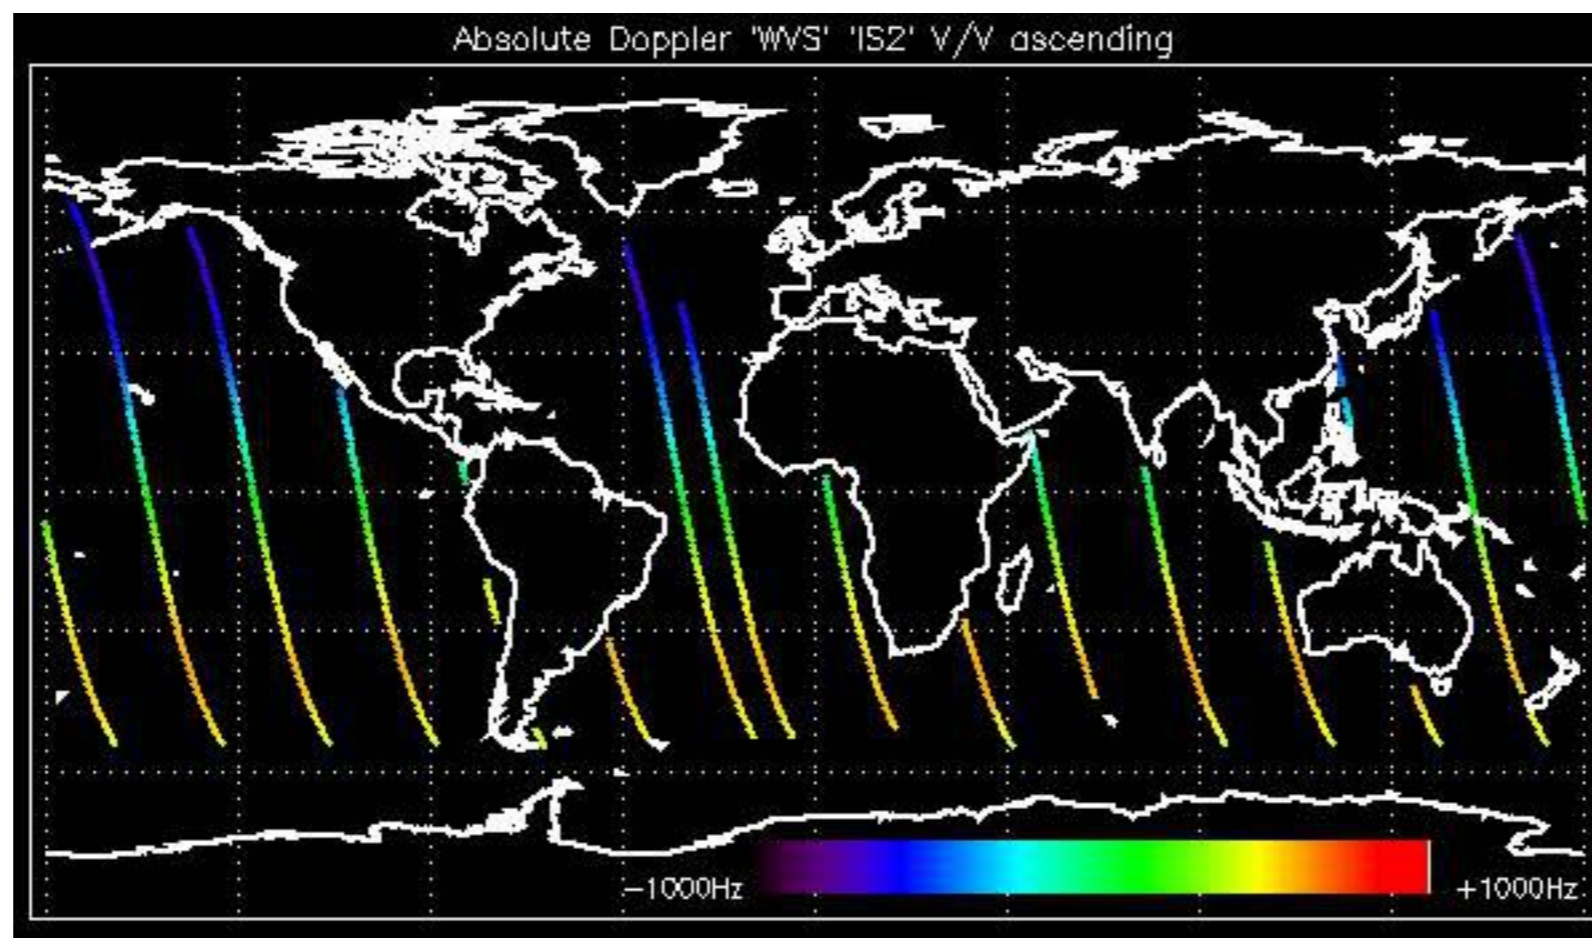


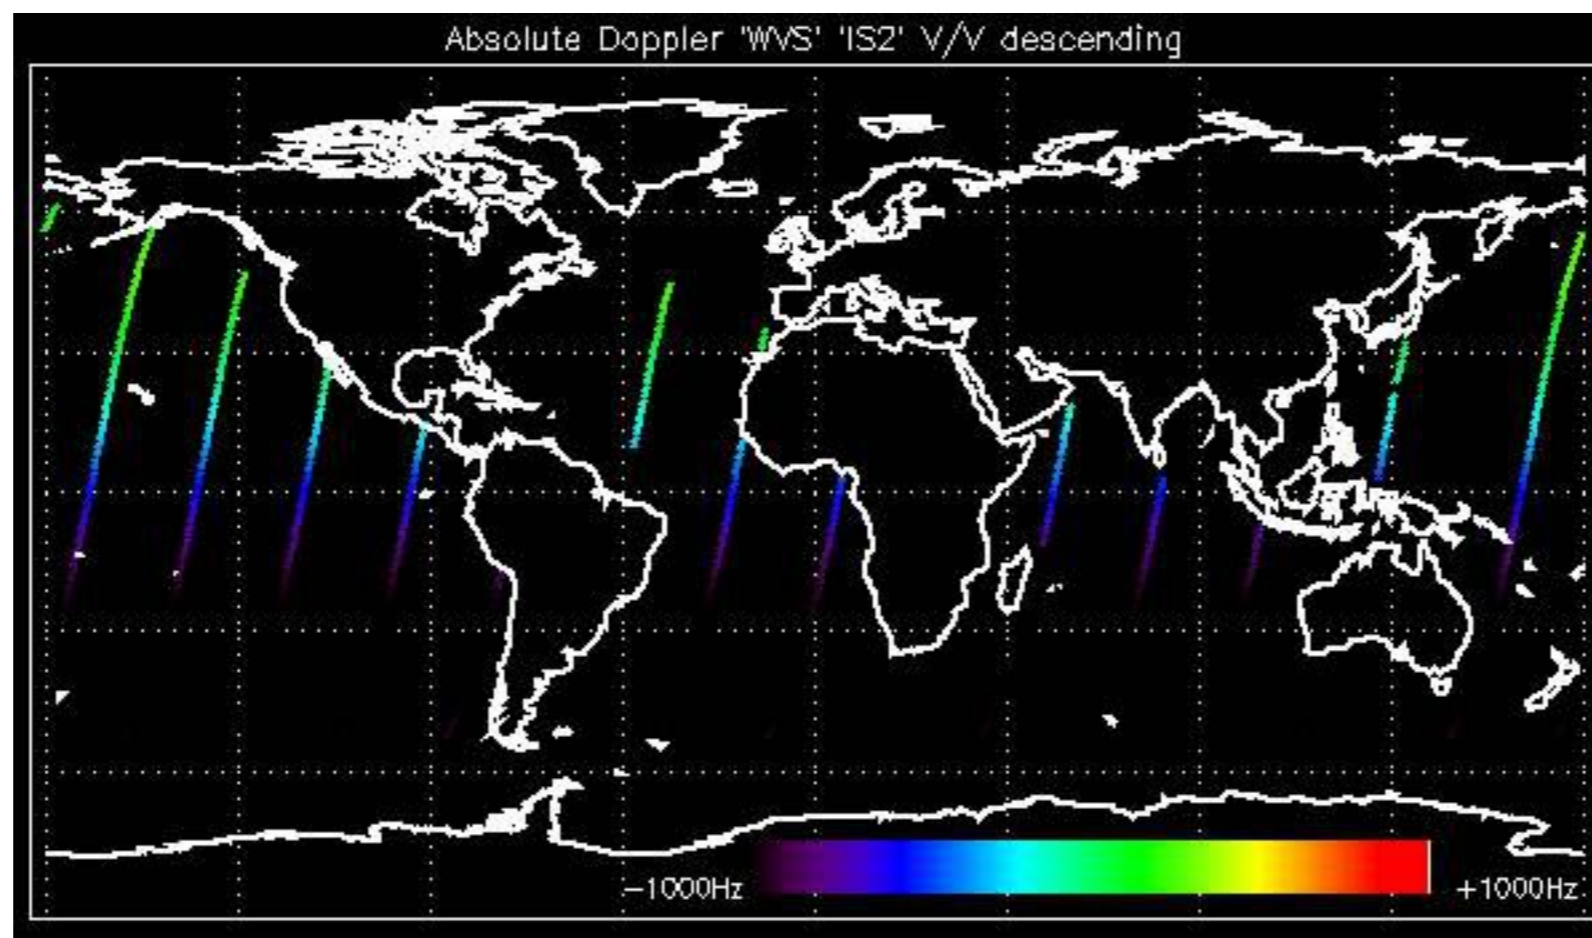


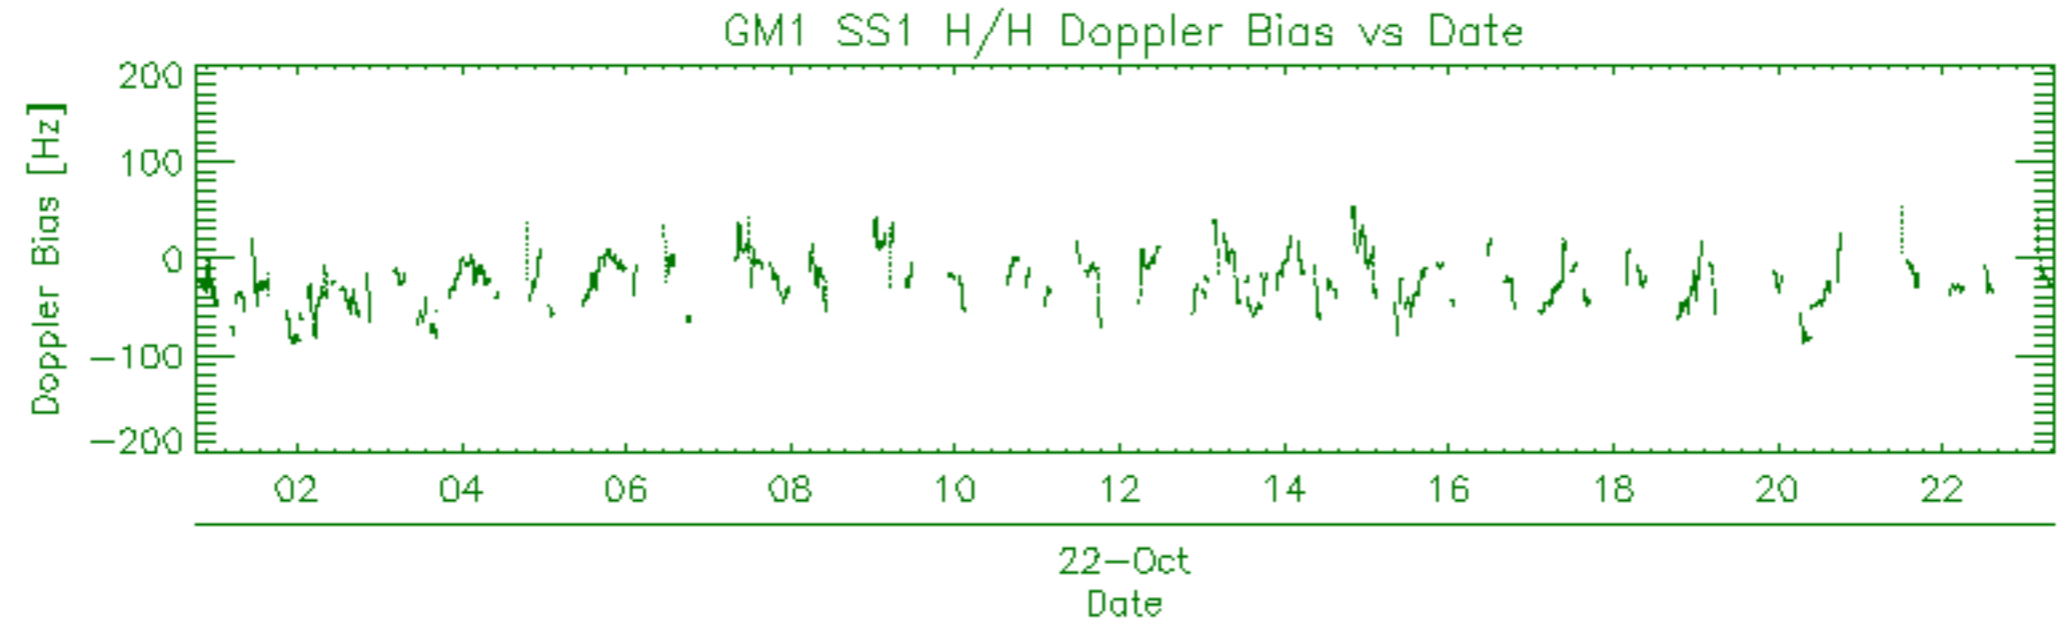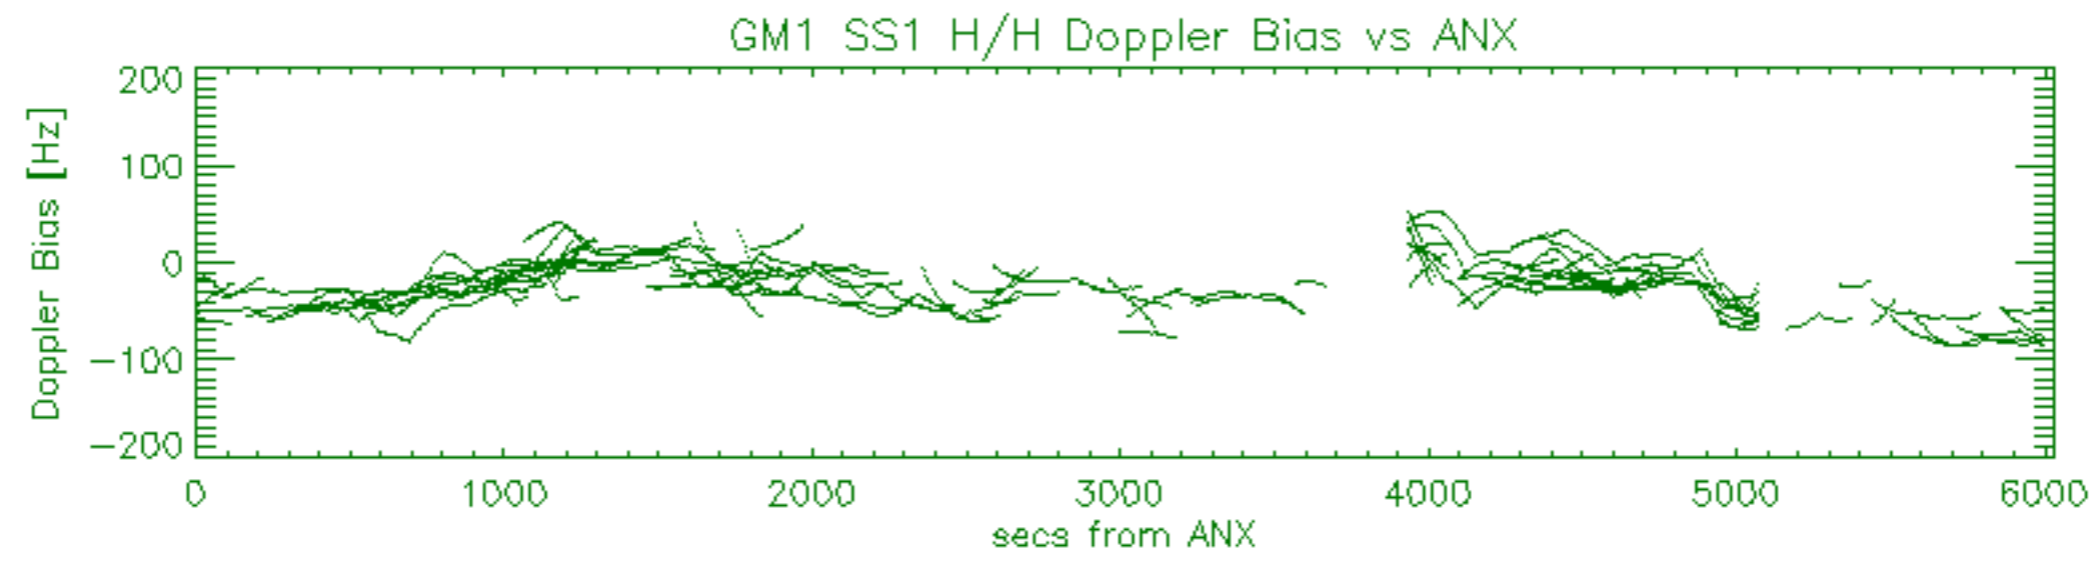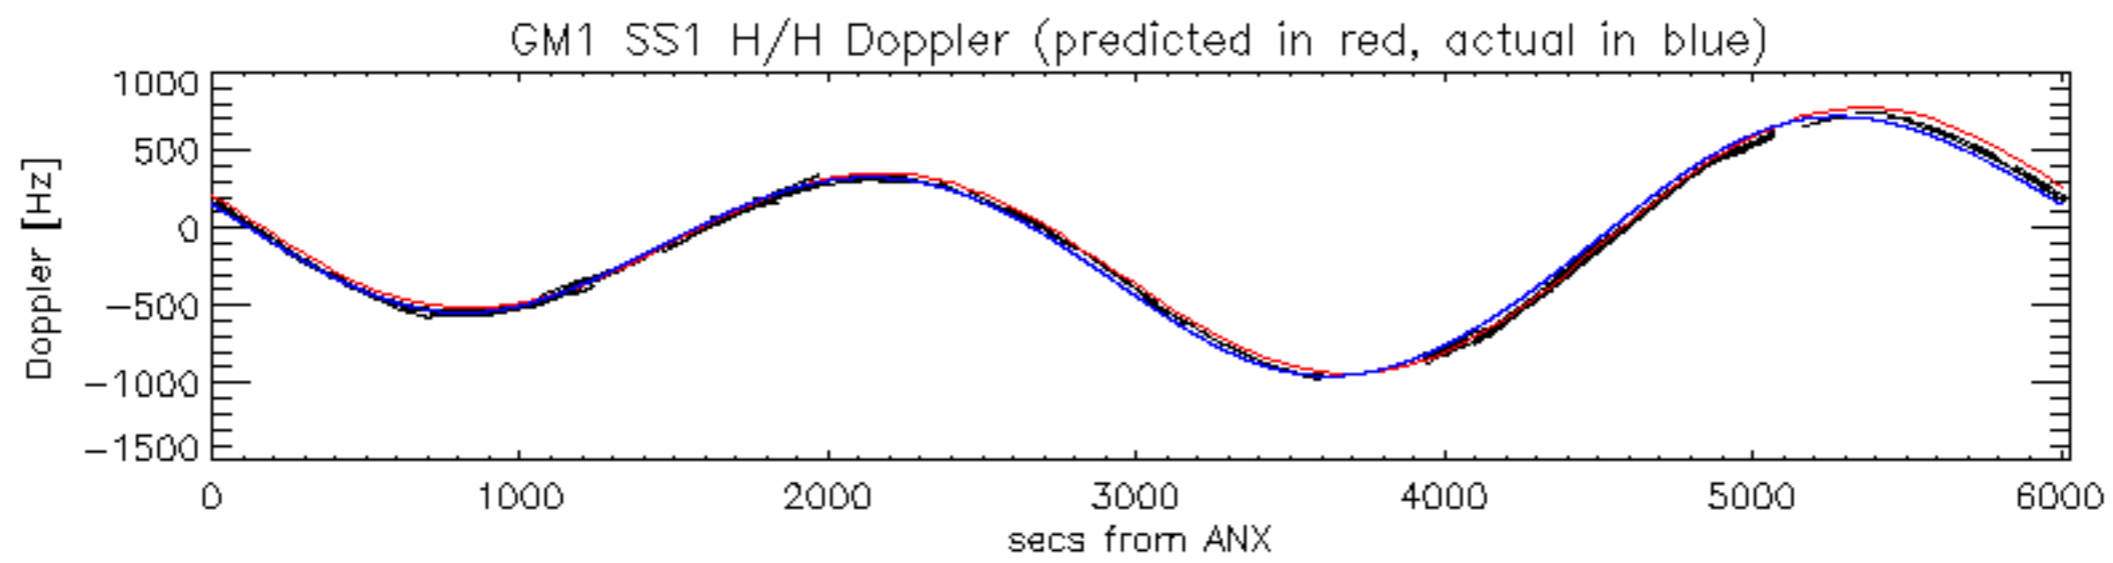



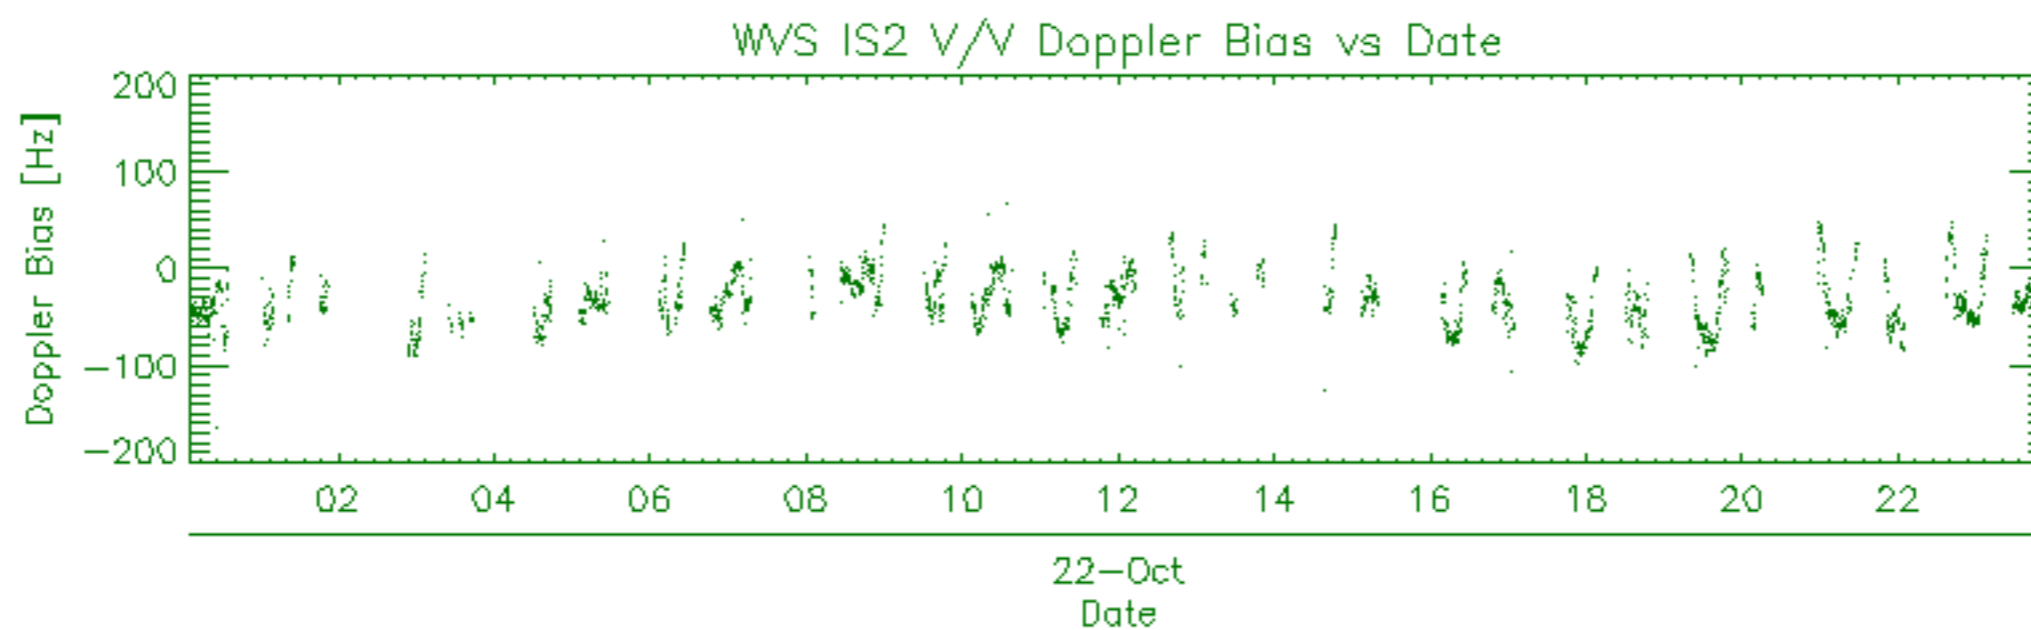
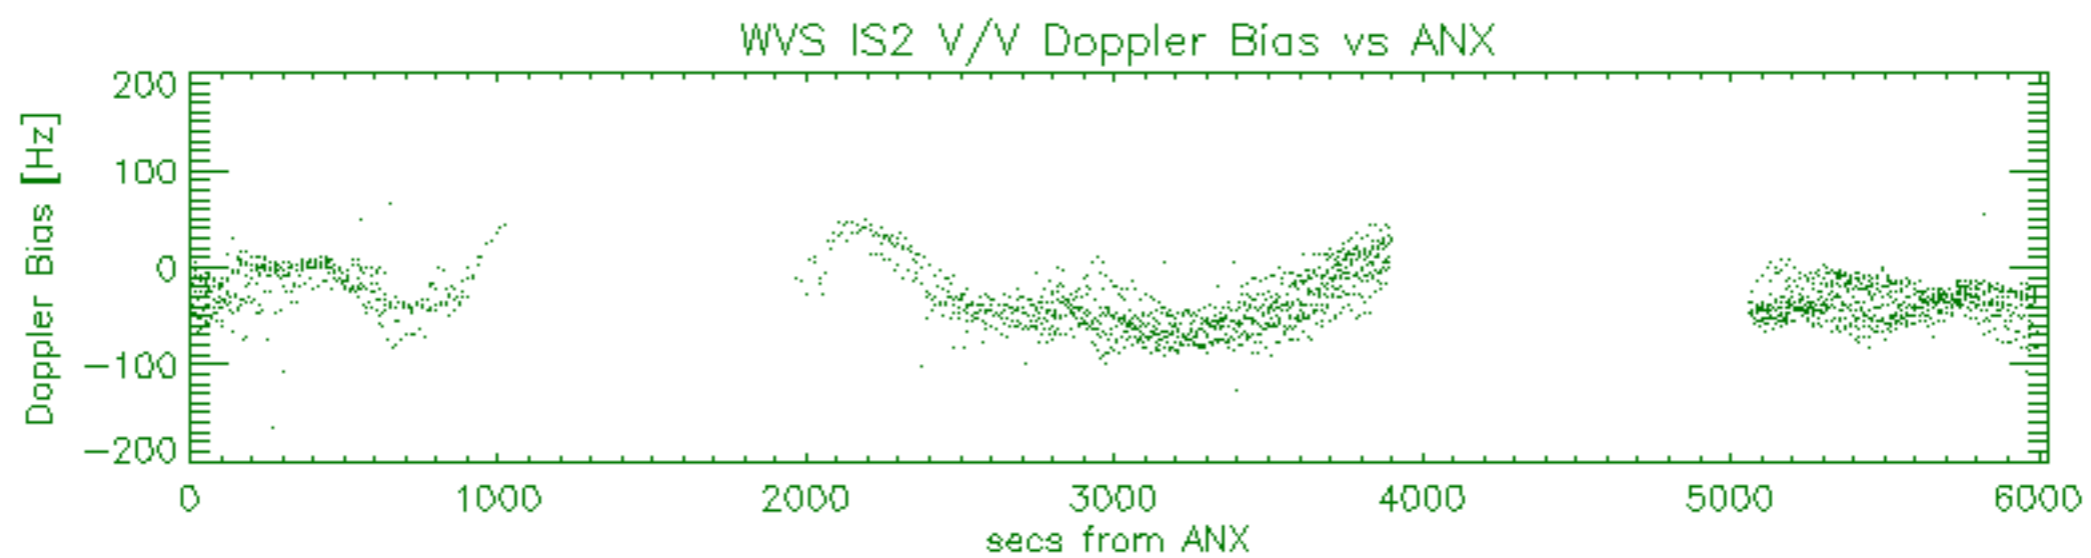
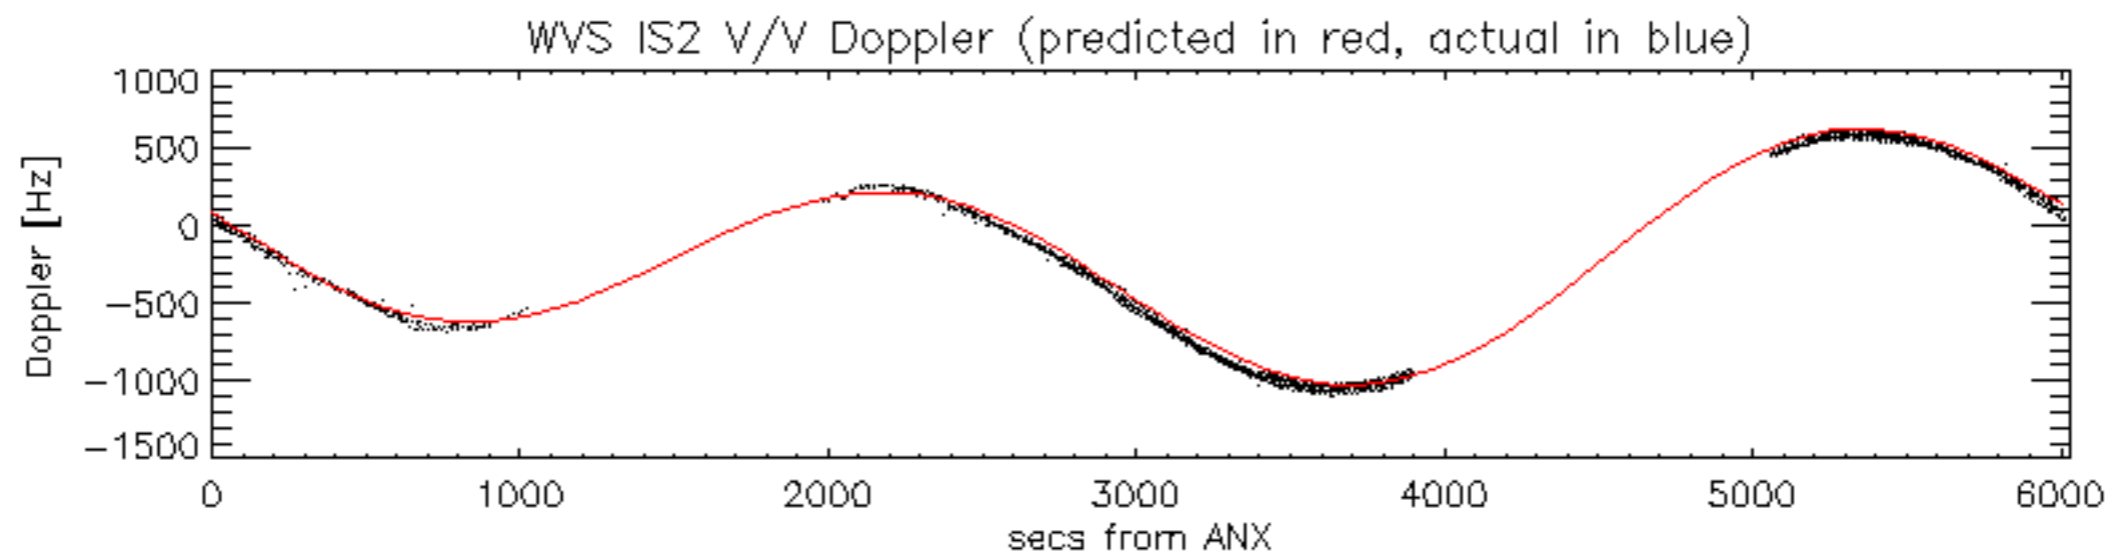


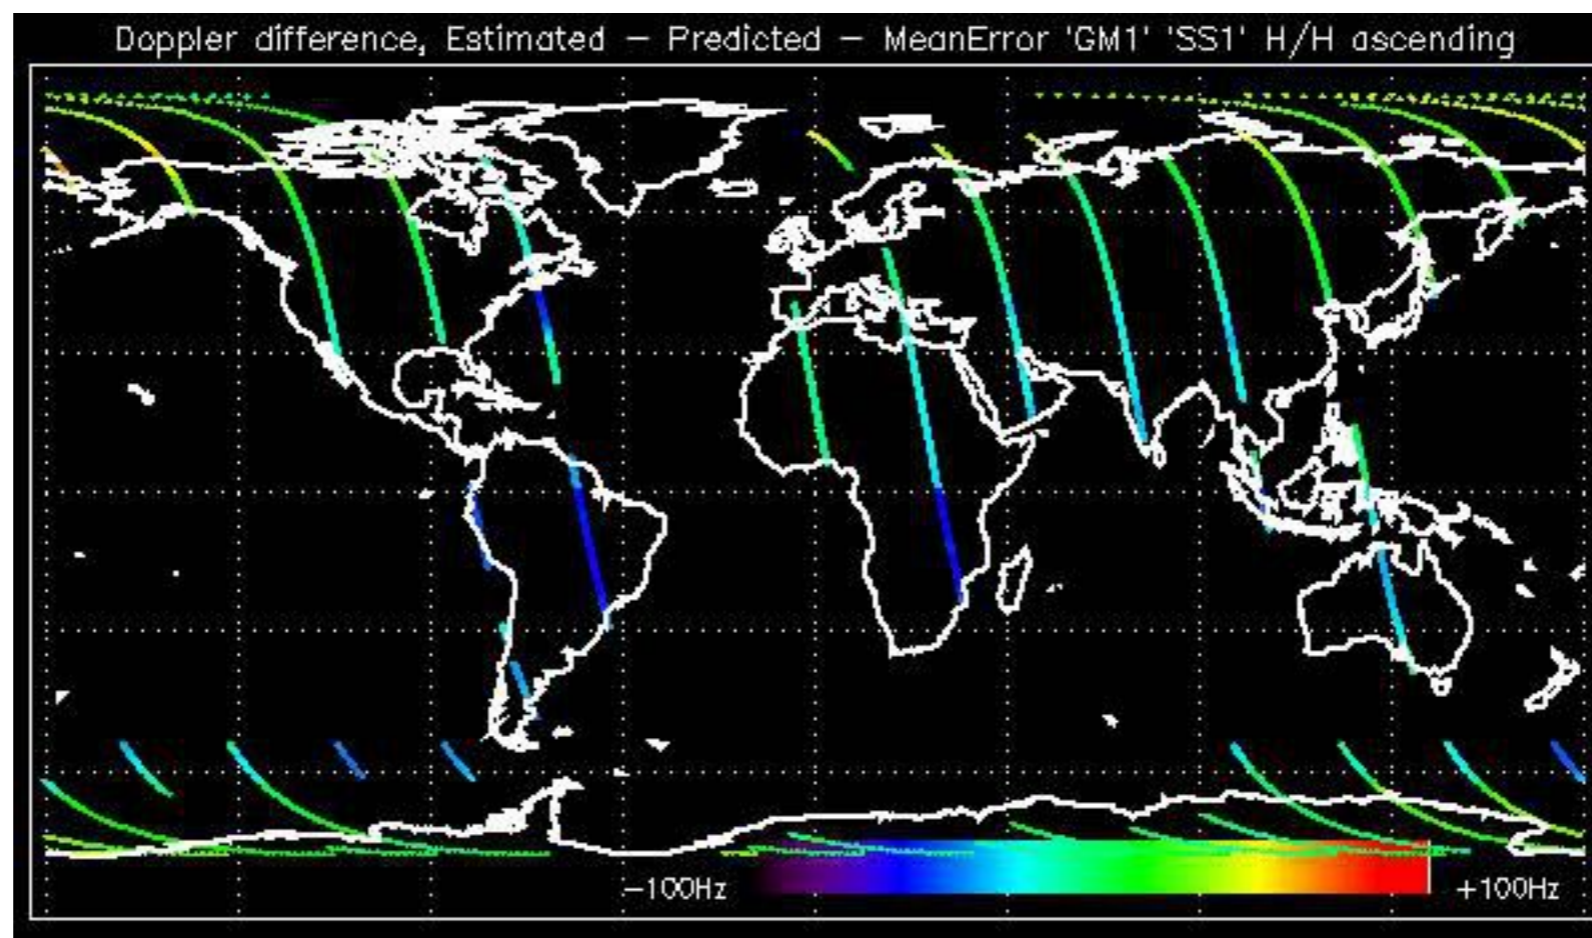


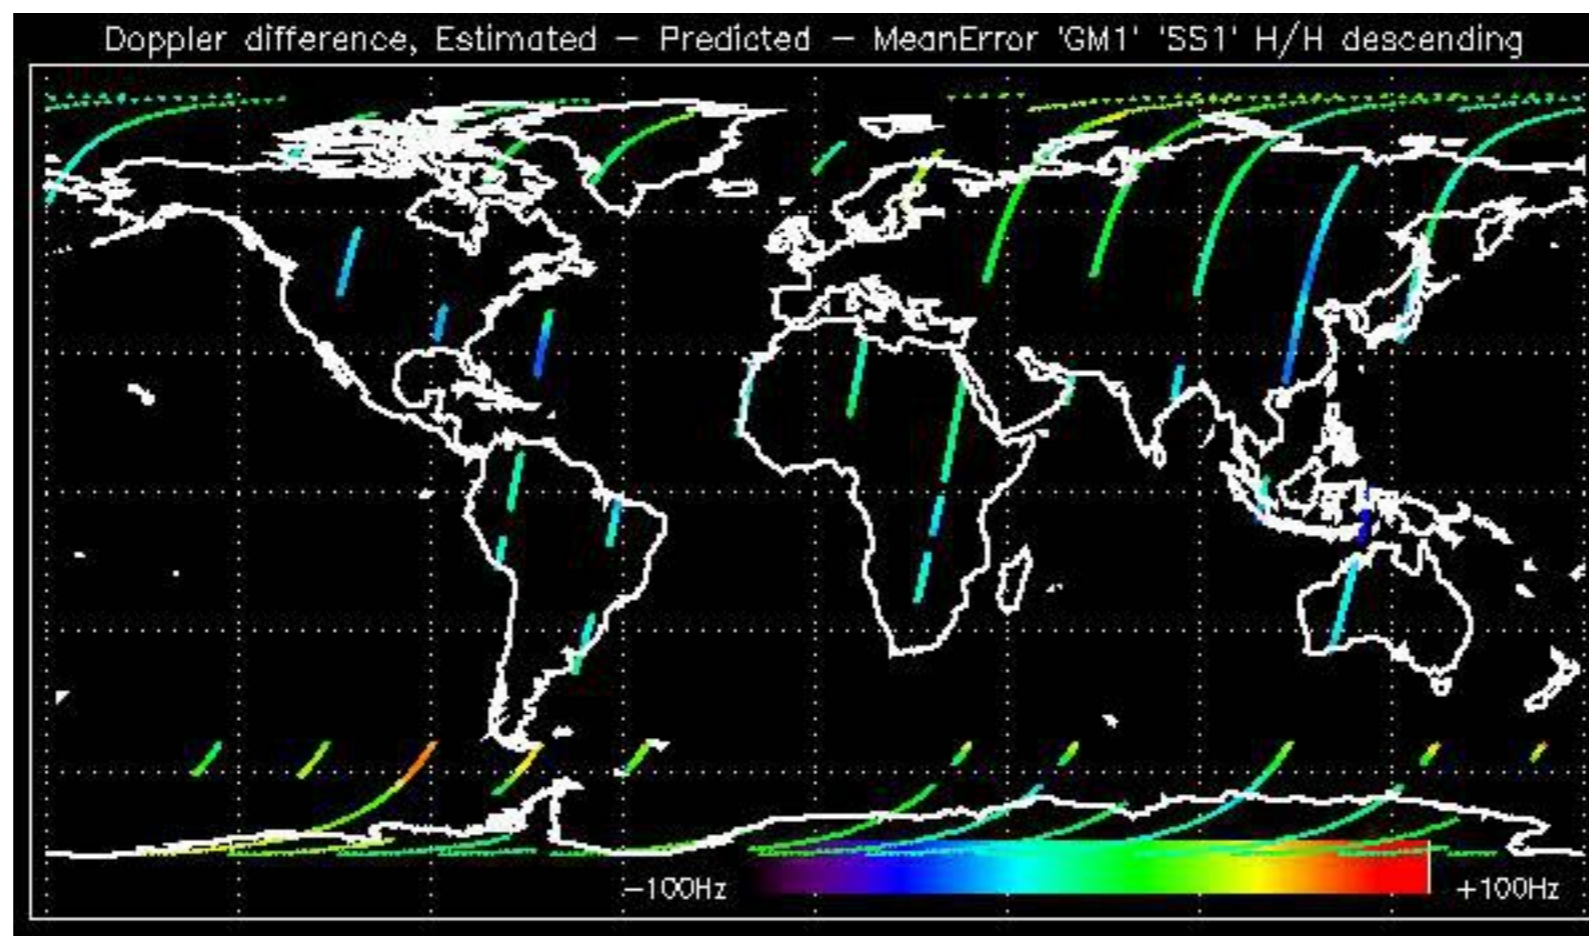




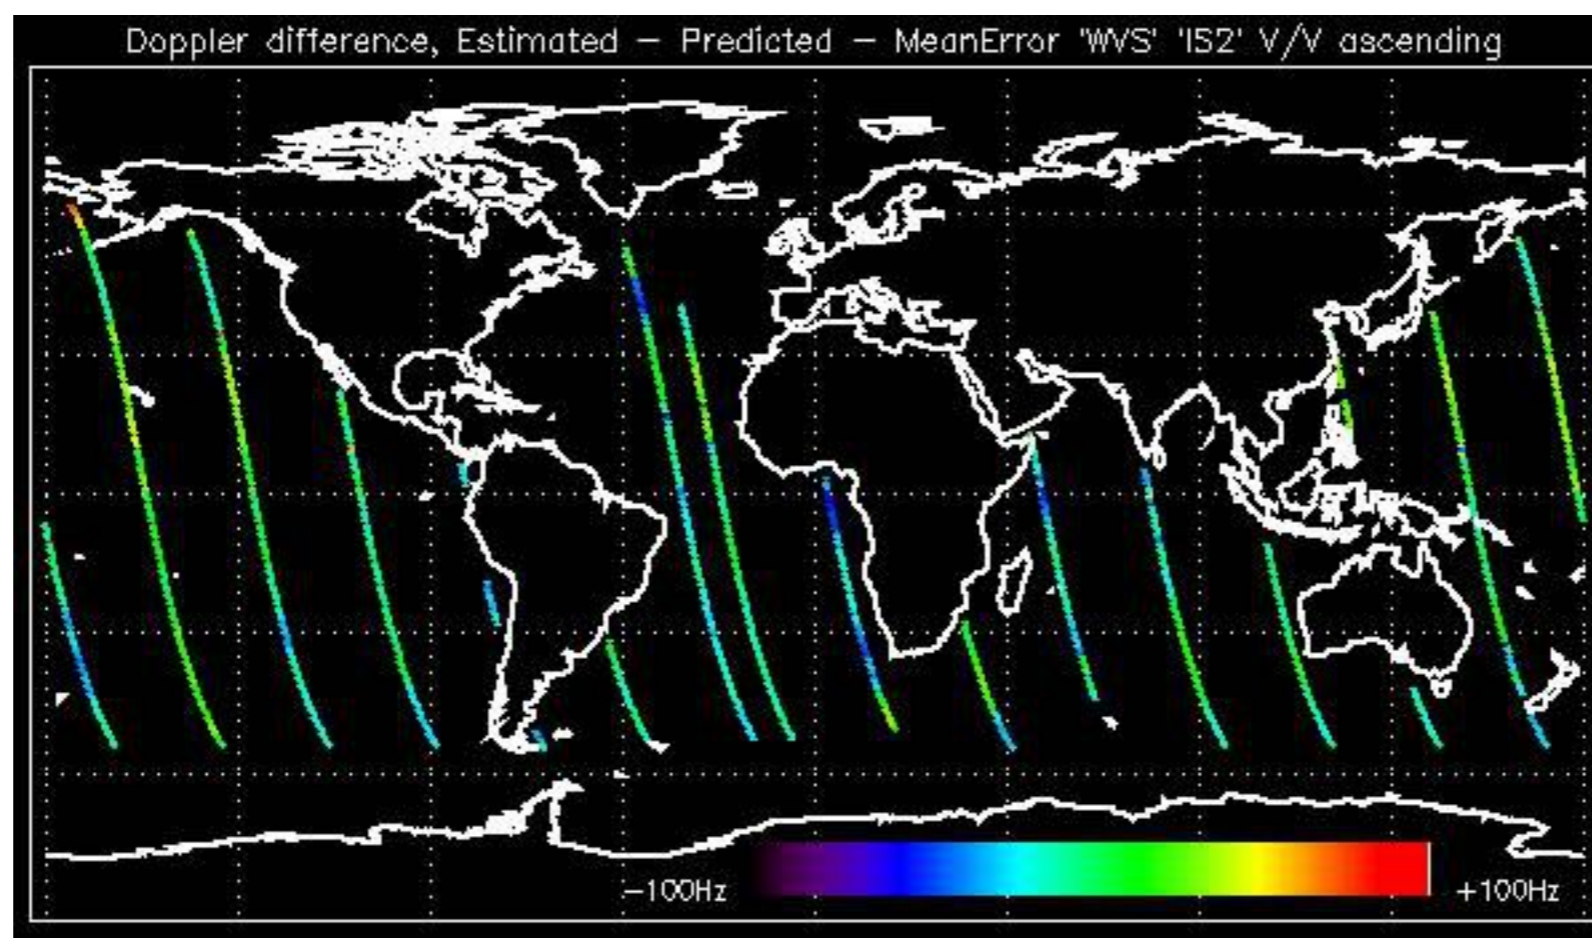


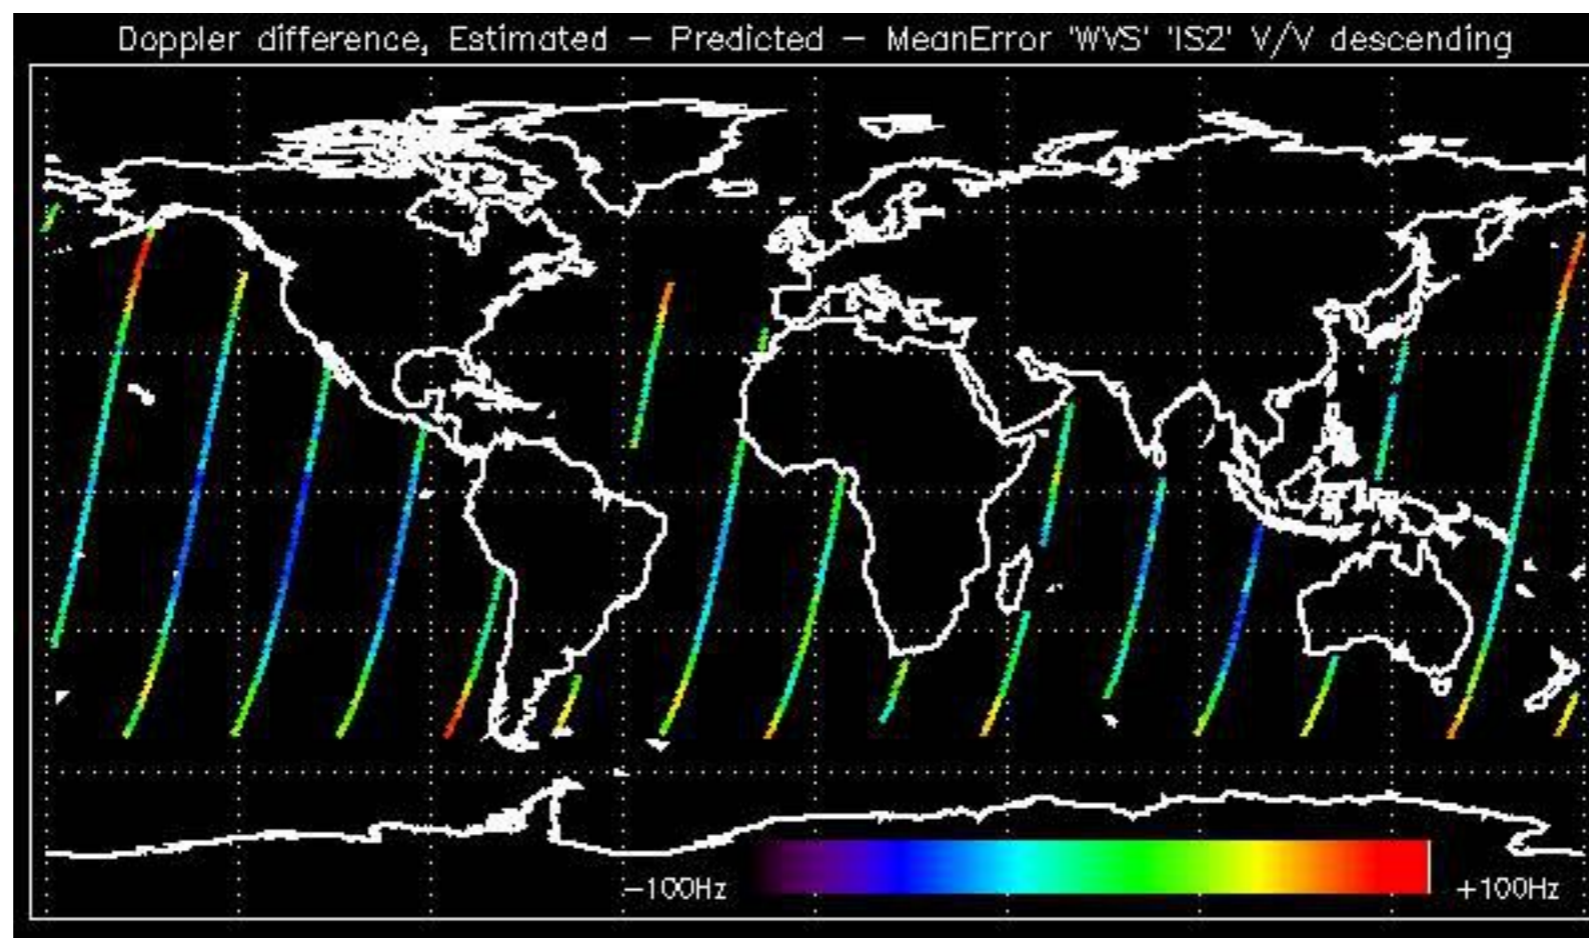


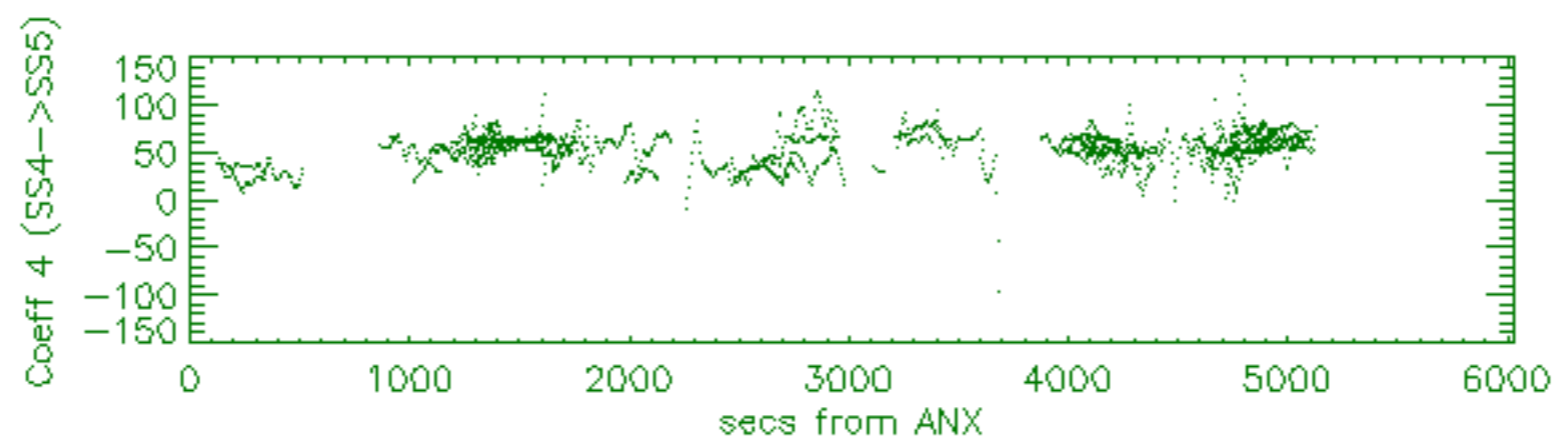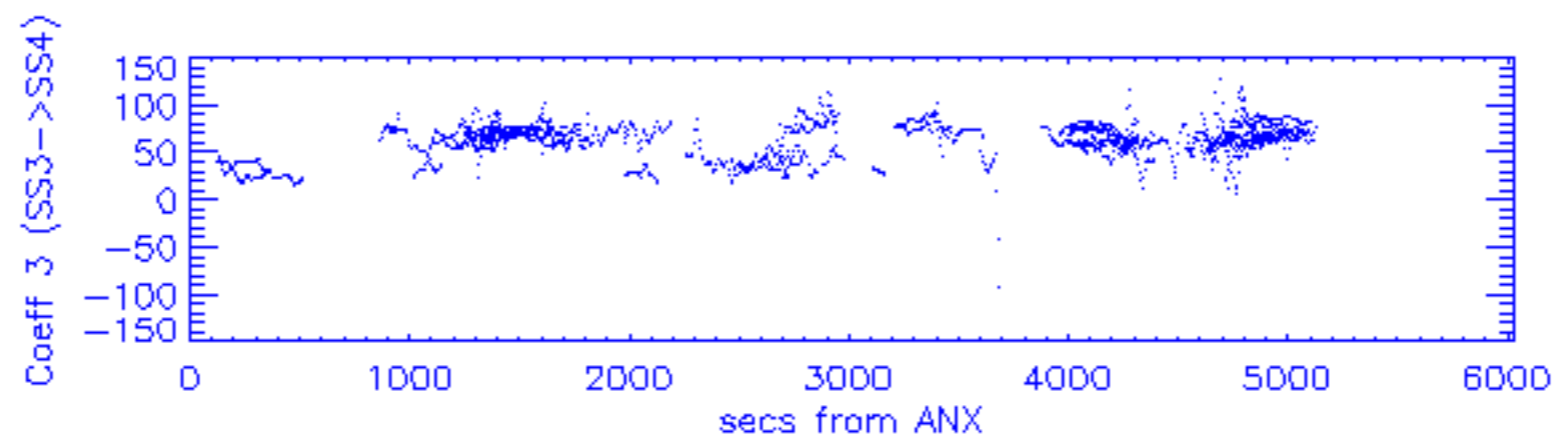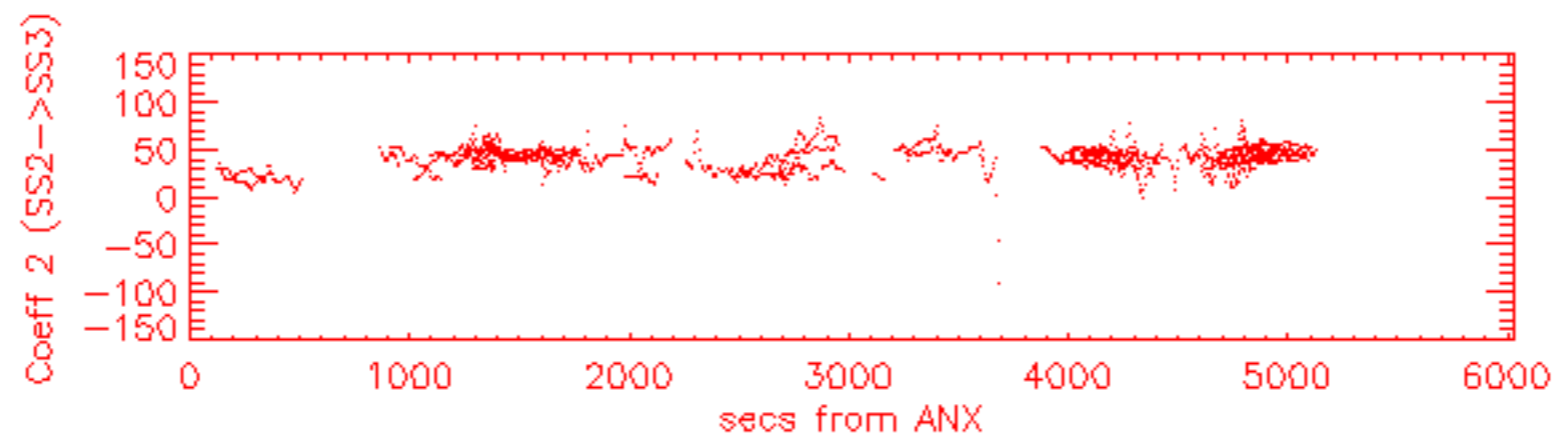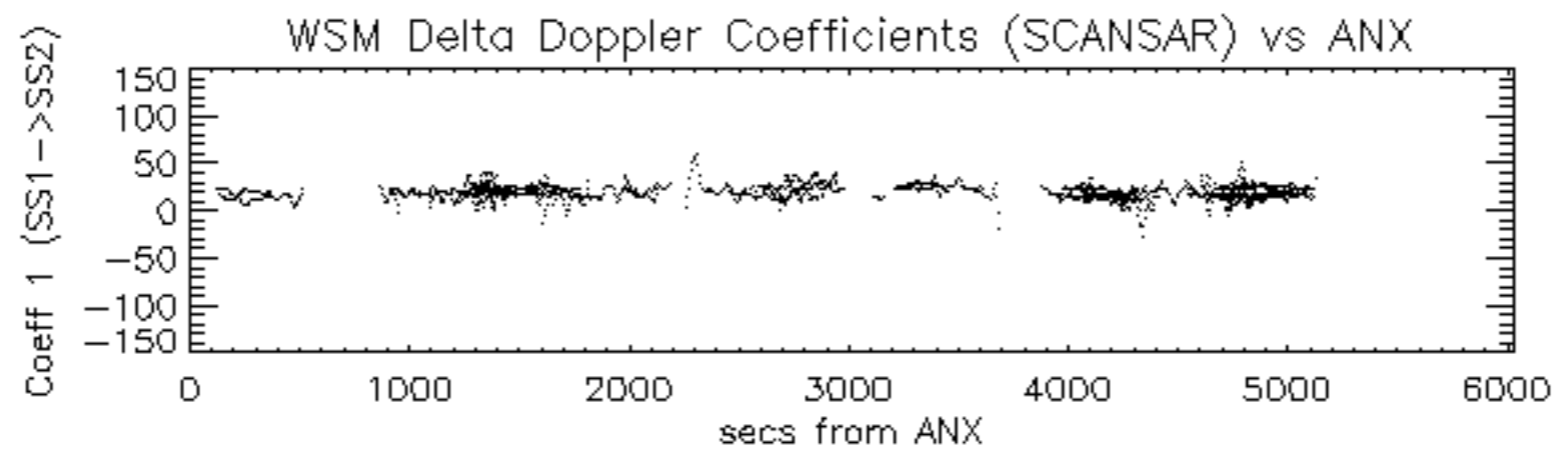

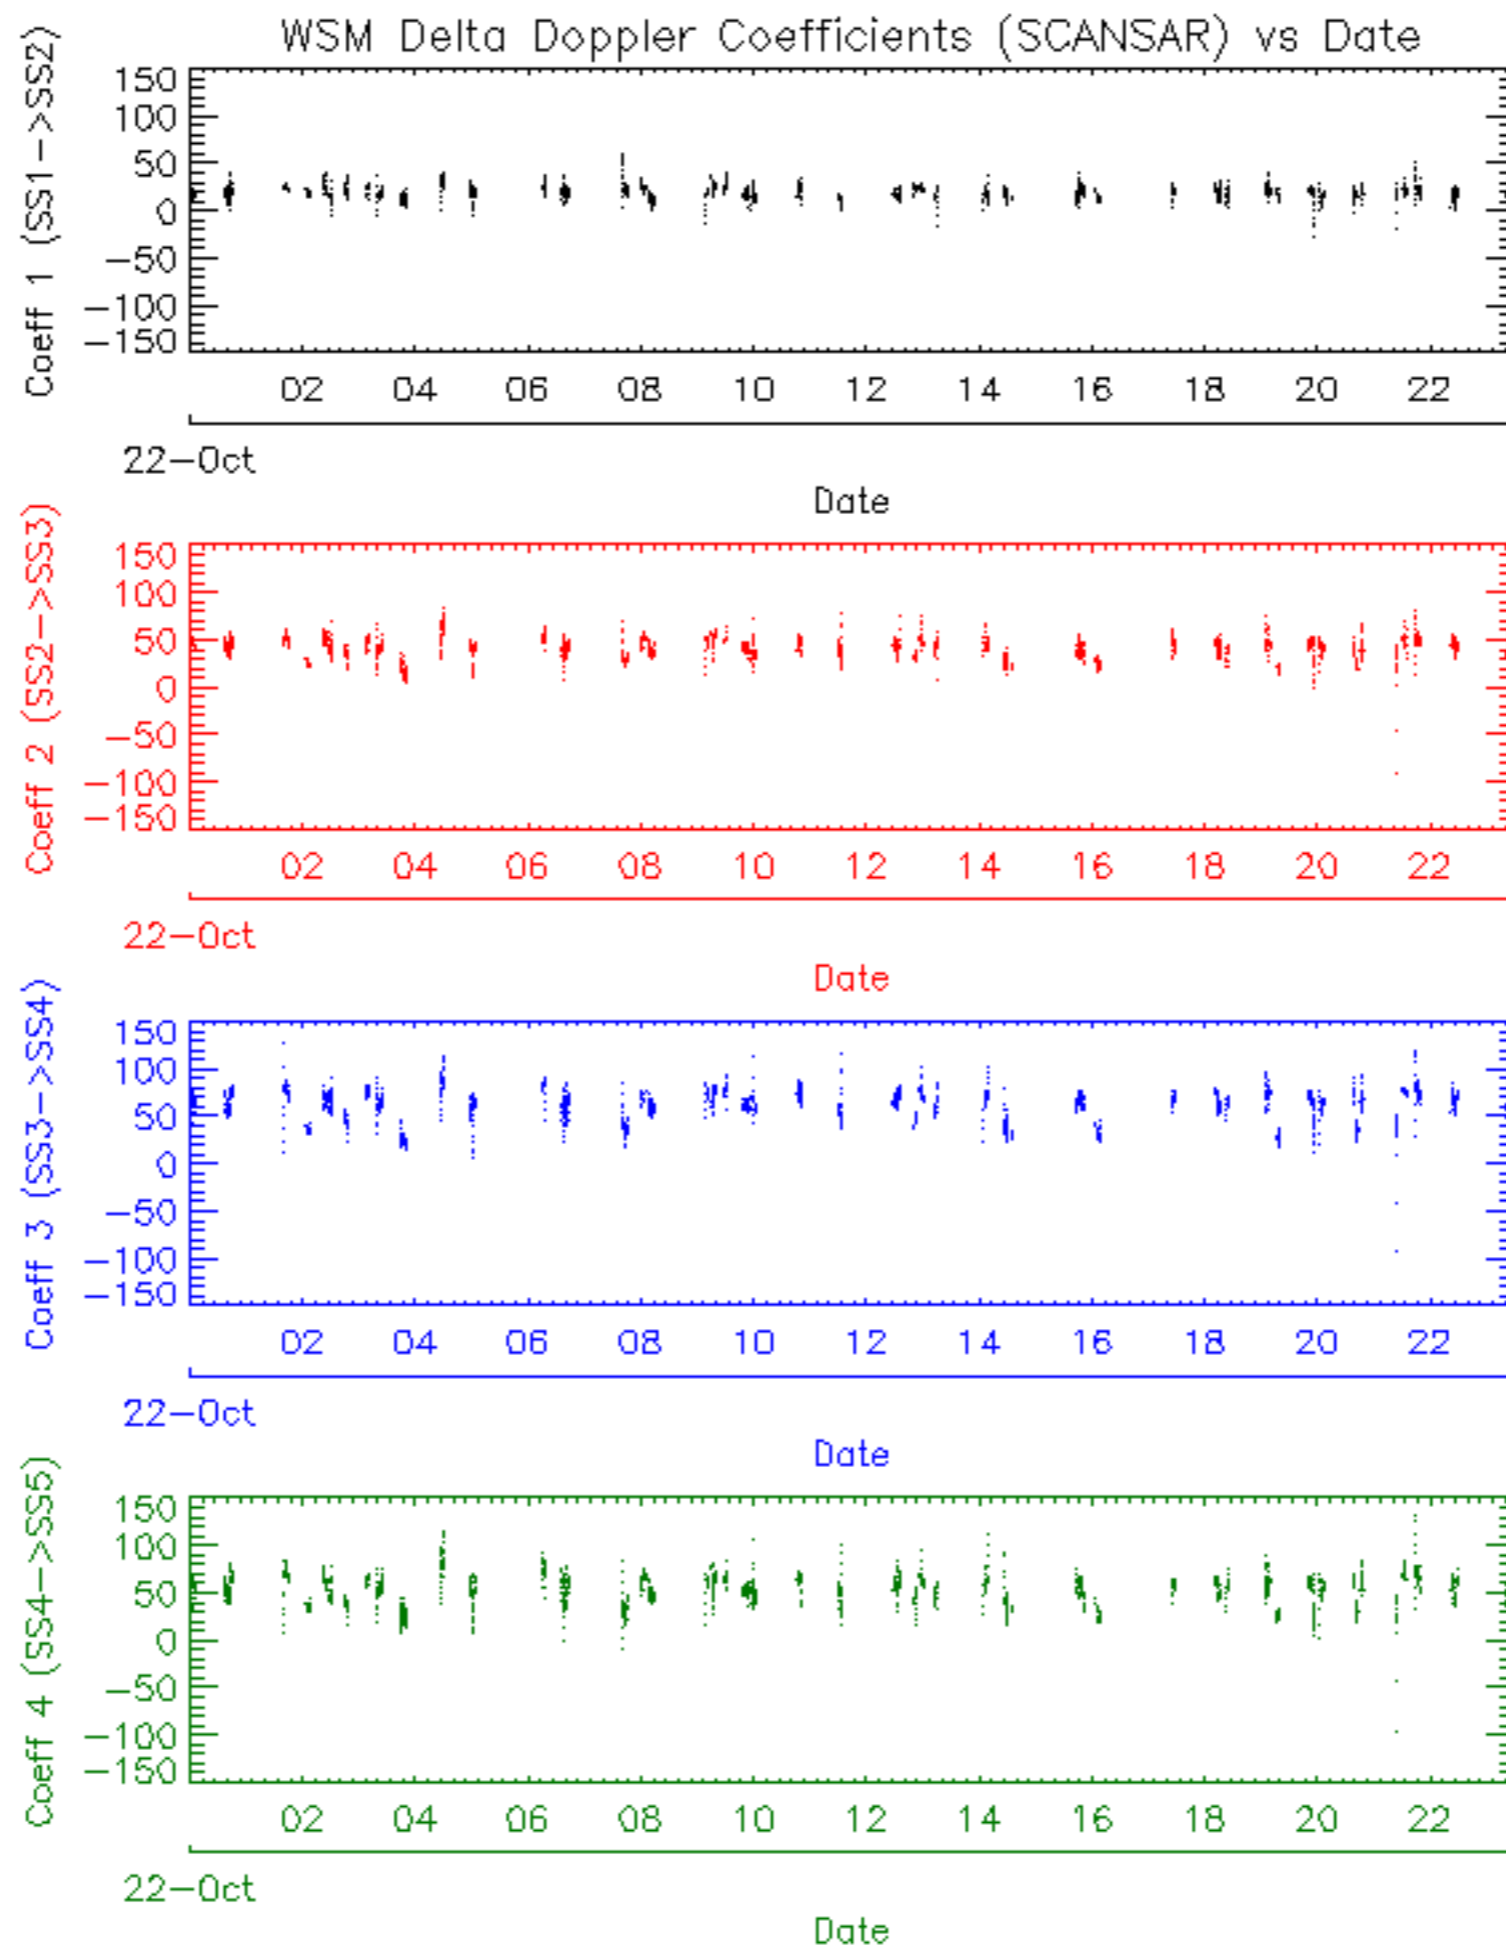


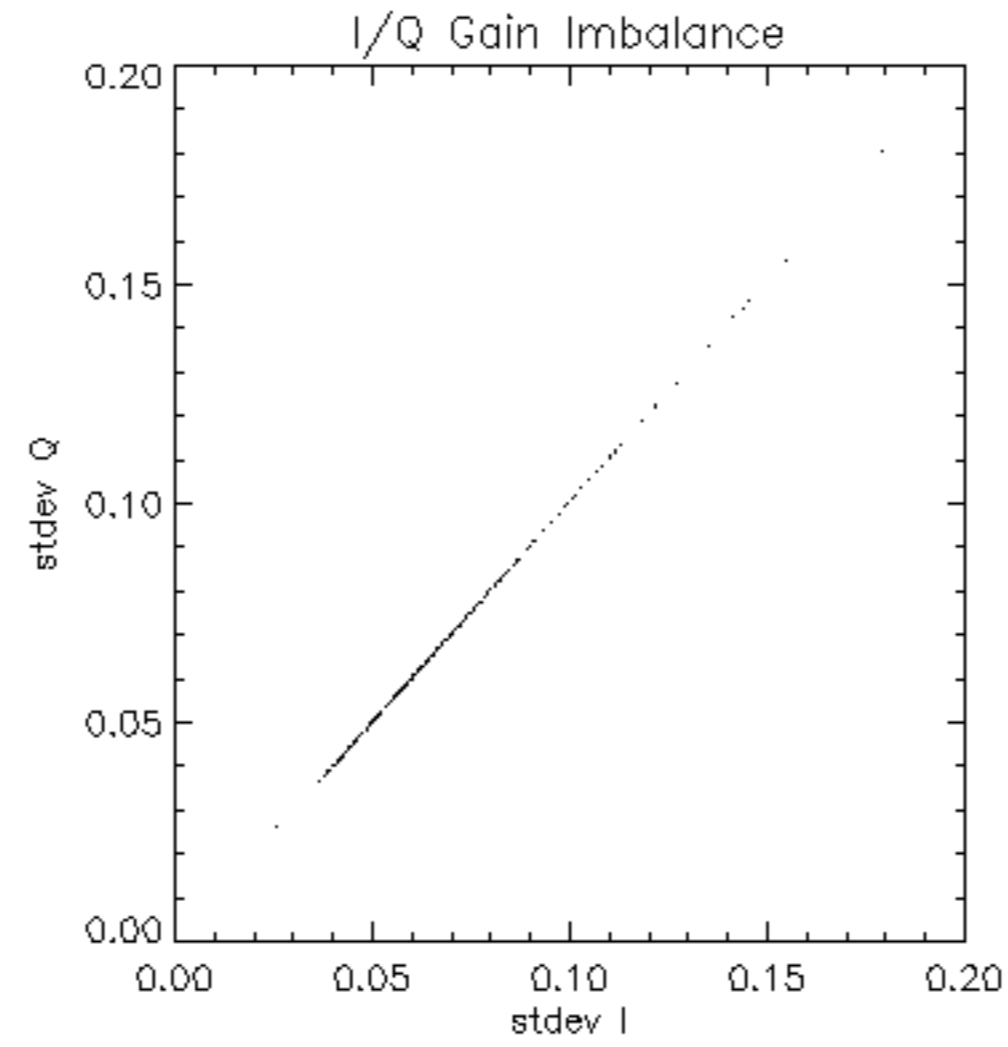

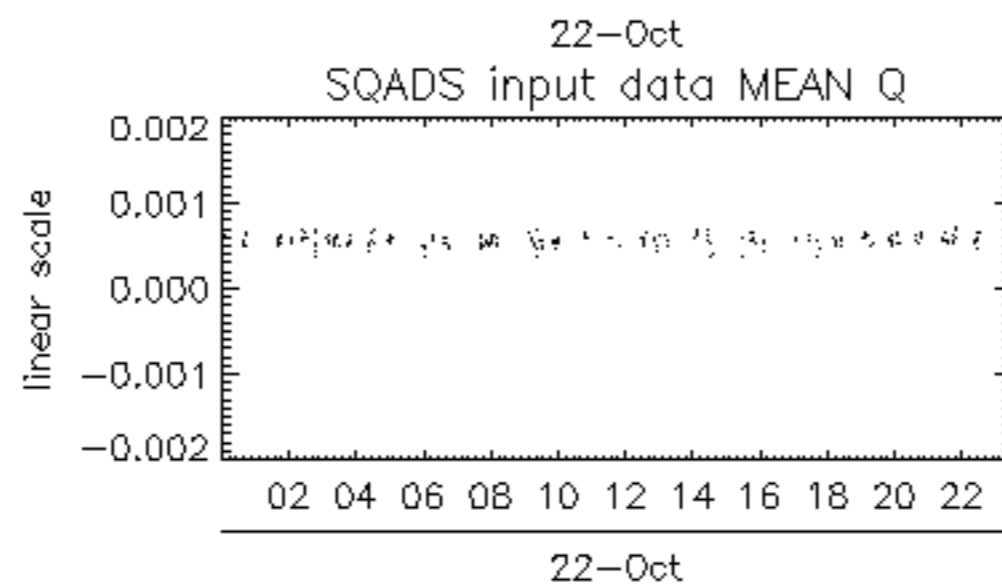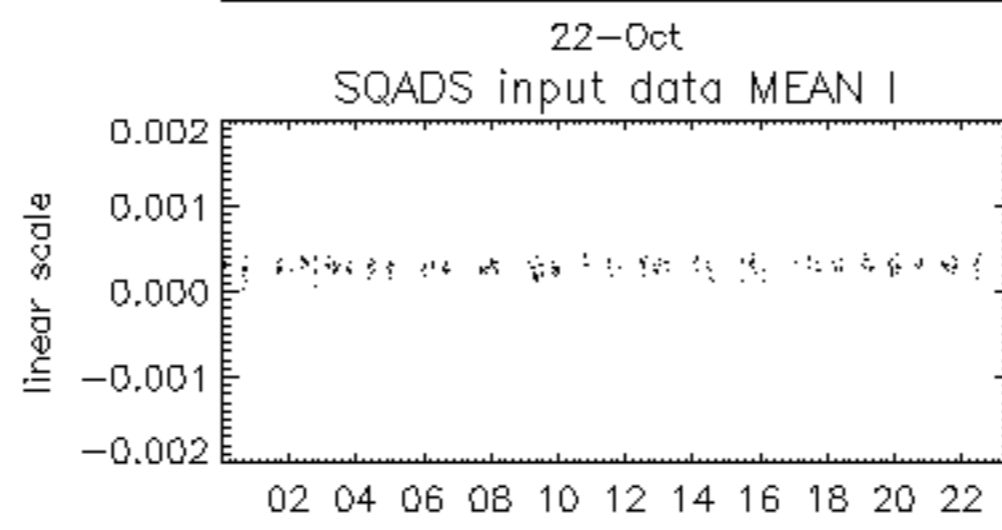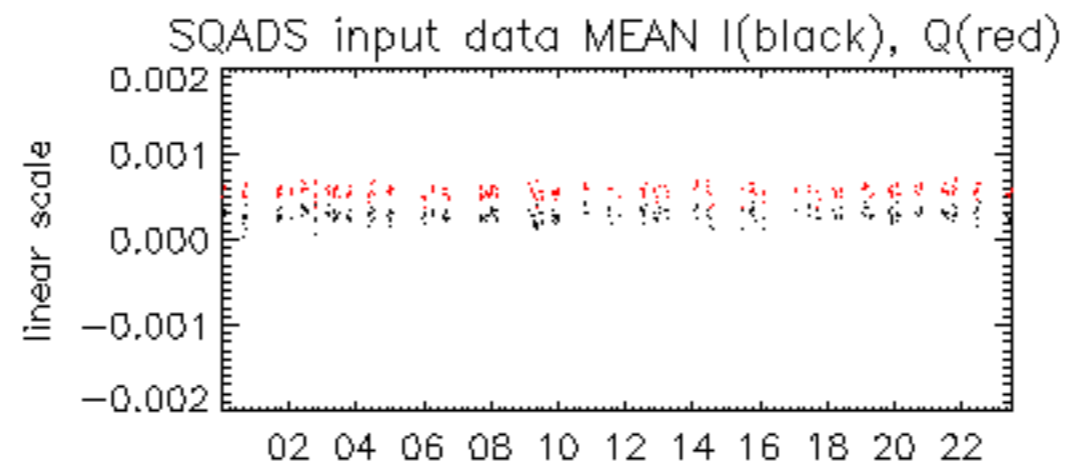


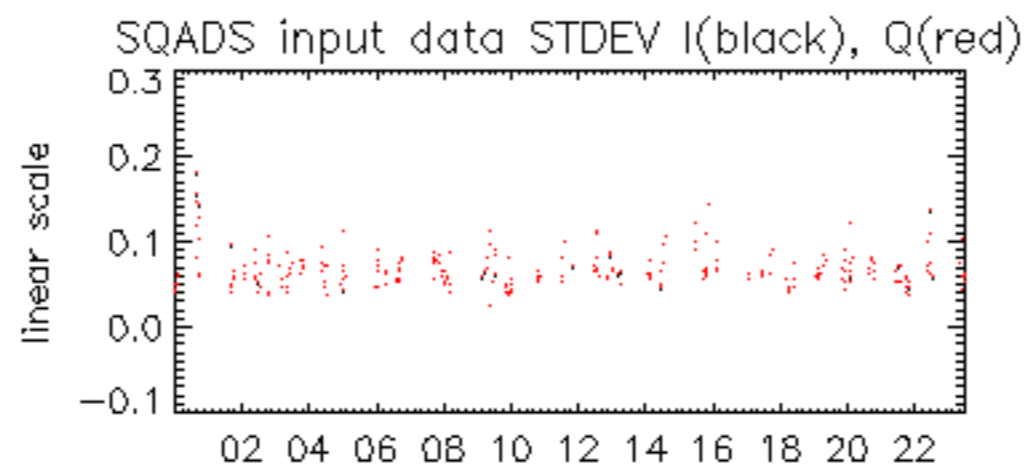


22-Oct

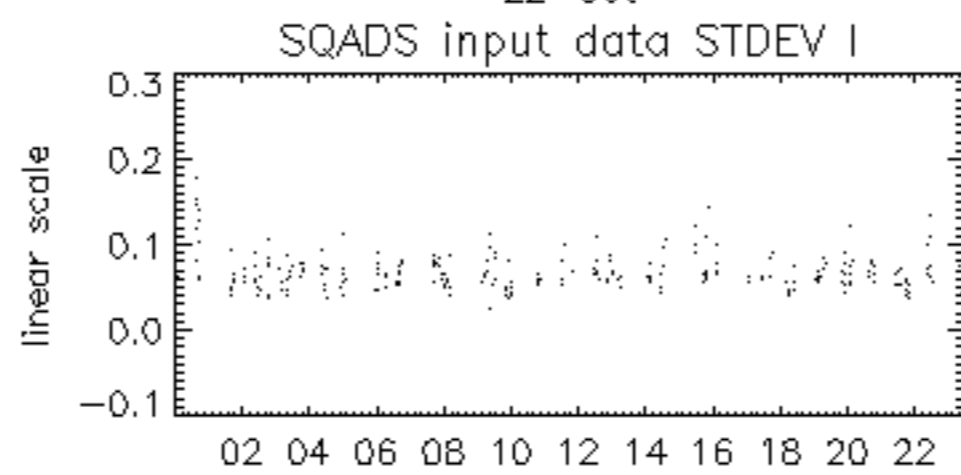


22-Oct

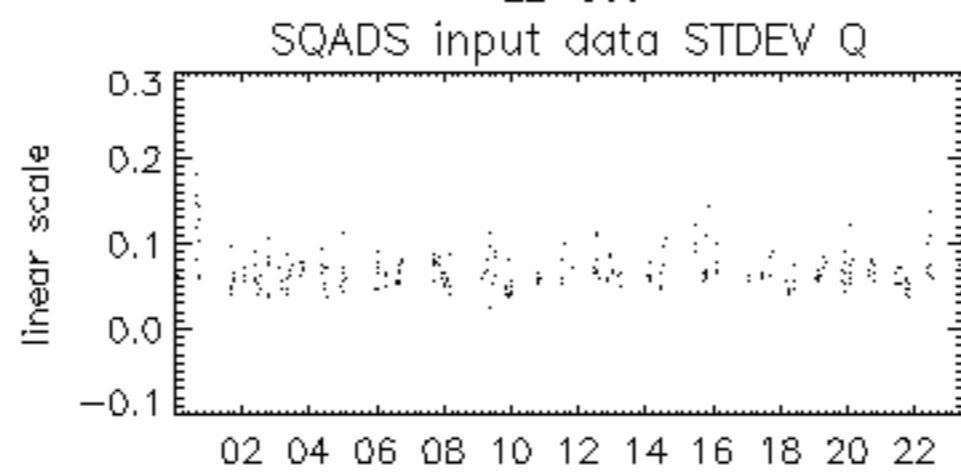


22-Oct

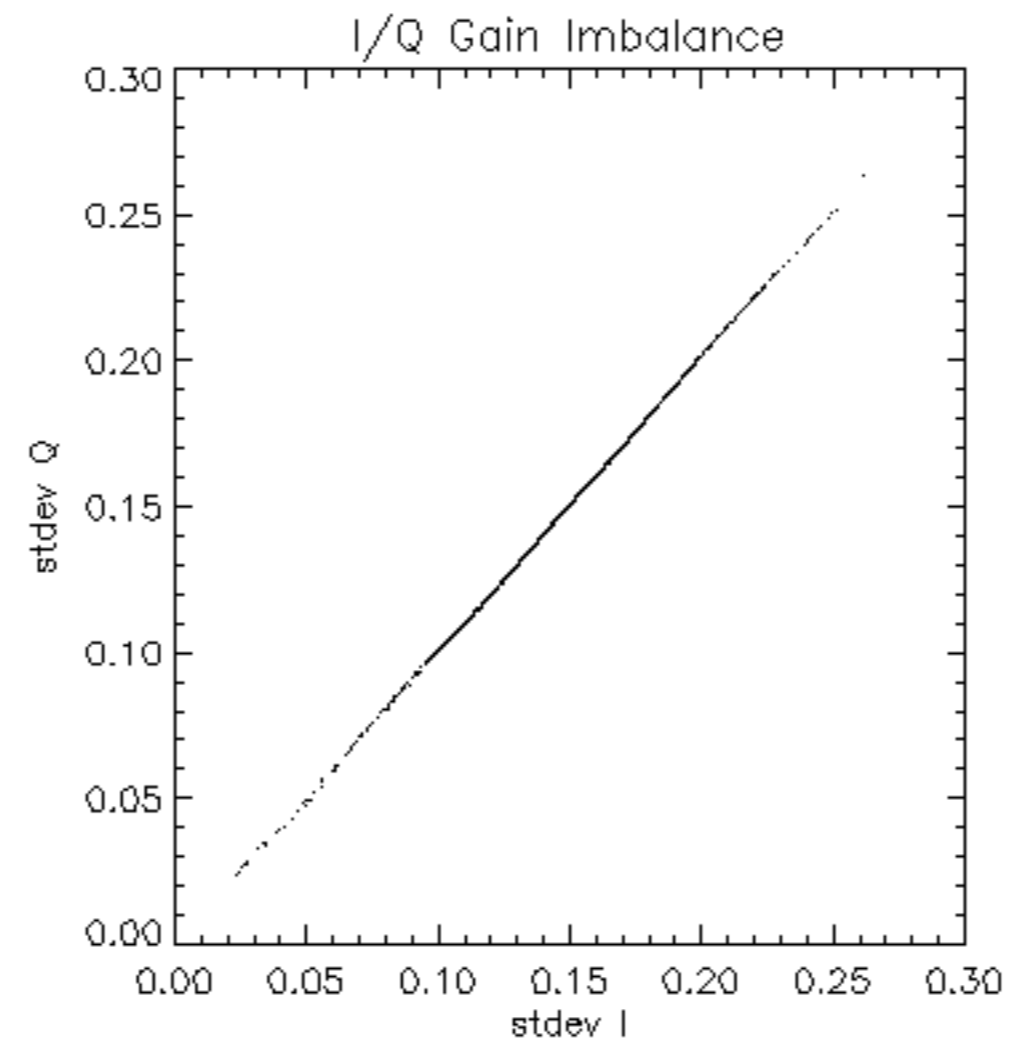


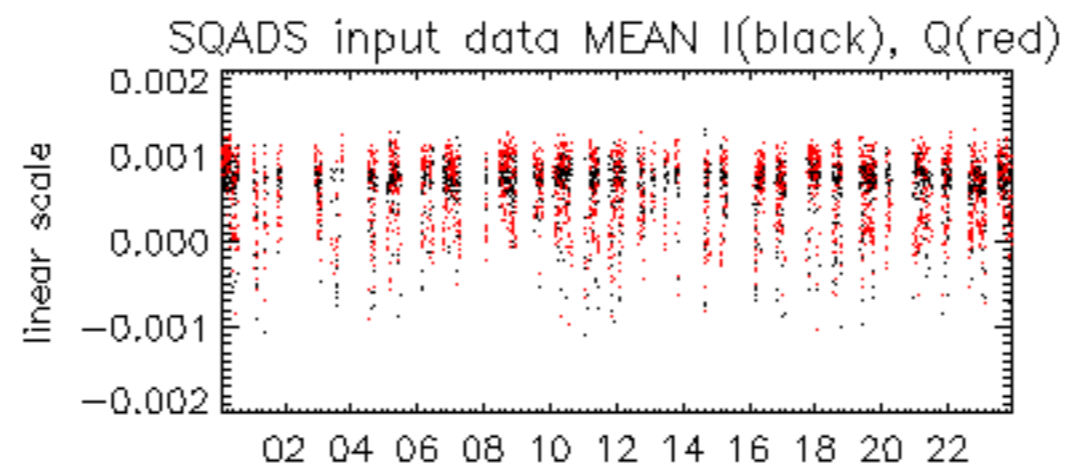

22-Oct

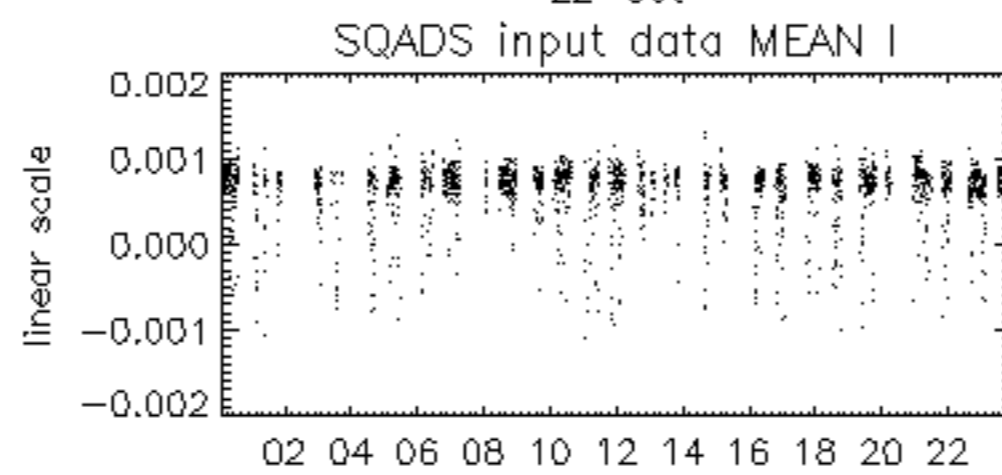

22-Oct

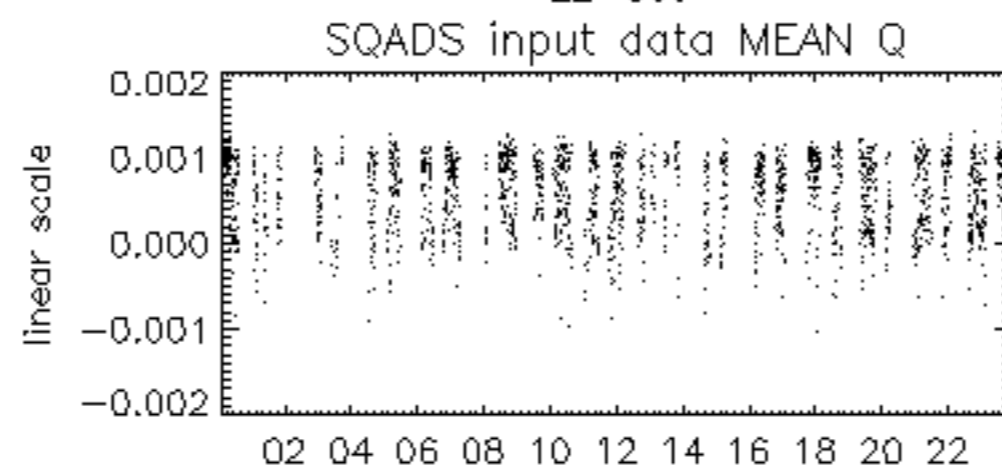

22-Oct

