



Analysis from 02-JAN-2012 00:00:00 to 02-JAN-2012 23:59:59. Page generated on 03-JAN-2012 06:31:38.
View log file: ASAR_Daily_Report_20120103_0631.log. For any anomalies please contact emma.hatton@vegaspaces.com, kajal.haria@vegaspaces.com.

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

SUMMARY

1. DATA SUMMARY
 - 1.1 Summary tables
 - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
 - 2.1 IECF operational ADFs list
 - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
 - 3.1 V/V polarisation
 - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
 - 4.1 Analysis for WVS IS2 V/V
 - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
 - 4.1.2 All Rows Analysis for WVS IS2 V/V
 - 4.2 Analysis for GM1 SS3 H/H
 - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
 - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
 - 5.1 Analysis for WVS IS2 V/V
 - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
 - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
 - 5.2 Analysis for GM1 SS1 H/H
 - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
 - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
 - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
 - 6.1 Analysis for WSM SS1 H/H
 - 6.1.1 ScaleFactor
 - 6.2 Analysis for WSM SS1 V/V
 - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
 - 7.1 Analysis for WVS
 - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
 - 8.1 Number of Missing Lines
 - 8.2 Number of Gaps

1 - DATA SUMMARY

1.1 - Summary tables

[[BACK TO MENU](#)]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	1	PDE	WS	H/H	36	PDE	IS1	V/H	2	PDE	IS1	V/V	1	PDE	WS	H/H	34	PDK	2012-01-02 15:50:35	H	320
PDE	IS2	V/V	25	PDK	WS	H/H	38	PDE	IS2	H/H	2	PDE	IS2	V/V	2	PDE	WS	V/V	6	PDK	2012-01-02 17:30:49	V	320
PDK	IS2	V/V	25					PDE	IS4	V/H	1	PDE	IS5	V/V	1	PDK	WS	H/H	13				
								PDE	IS6	H/H	1	PDE	IS6	H/H	5	PDK	WS	V/V	3				
												PDE	IS6	V/V	1								
												PDE	IS7	V/V	1								
												PDK	IS6	H/H	3								
												PDK	IS7	H/H	1								

1.2 - Lists of products used

[[BACK TO MENU](#)]

[TXT] [XLS] [List_WVS_products_used](#)
 [TXT] [XLS] [List_GM1_products_used](#)
 [TXT] [XLS] [List_APM_products_used](#)
 [TXT] [XLS] [List_IMM_products_used](#)
 [TXT] [XLS] [List_WSM_products_used](#)
 [TXT] [XLS] [List_MS_products_used](#)

2 - AUXILIARY FILES ANALYSIS

2.1 - IECF operational ADFs list

[[BACK TO MENU](#)]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20110526_075001_20101027_215740_20141231_000000
ASA_INS_AXVIEC20110124_114858_20101228_112000_20141231_235959
ASA_XCH_AXVIEC20101222_143057_20020301_000000_20141231_000000
ASA_XCA_AXVIEC20110526_075734_20101027_215740_20141231_000000

2.2 - Products with wrong ADFs





[[BACK TO MENU](#)]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0

[TXT] [XLS] [Check_ADFs_WVS](#)
 [TXT] [XLS] [Check_ADFs_GM1](#)
 [TXT] [XLS] [Check_ADFs_APM](#)
 [TXT] [XLS] [Check_ADFs_IMM](#)

3 - MODULE STEPPING PRODUCTS ANALYSIS







SECOND FIXED REFERENCE										PREVIOUS PRODUCT REFERENCE									
Pre-launch reference (2001-02-09)										Previous product in the same polarisation									
Reference: 2001-02-09 14:08:23 V Test : 2012-01-02 17:30:49 V										Reference: 2012-01-01 18:07:34 V Test : 2012-01-02 17:30:49 V									
RxGain										RxGain									
A1	A3	B1	B3	C1	C3	D1	D3	E1	E3	A1	A3	B1	B3	C1	C3	D1	D3	E1	E3
A2	A4	B2	B4	C2	C4	D2	D4	E2	E4	A2	A4	B2	B4	C2	C4	D2	D4	E2	E4
RxPhase										RxPhase									
Reference: 2001-02-09 14:08:23 V Test : 2012-01-02 17:30:49 V										Reference: 2012-01-01 18:07:34 V Test : 2012-01-02 17:30:49 V									
A1	A3	B1	B3	C1	C3	D1	D3	E1	E3	A1	A3	B1	B3	C1	C3	D1	D3	E1	E3
A2	A4	B2	B4	C2	C4	D2	D4	E2	E4	A2	A4	B2	B4	C2	C4	D2	D4	E2	E4

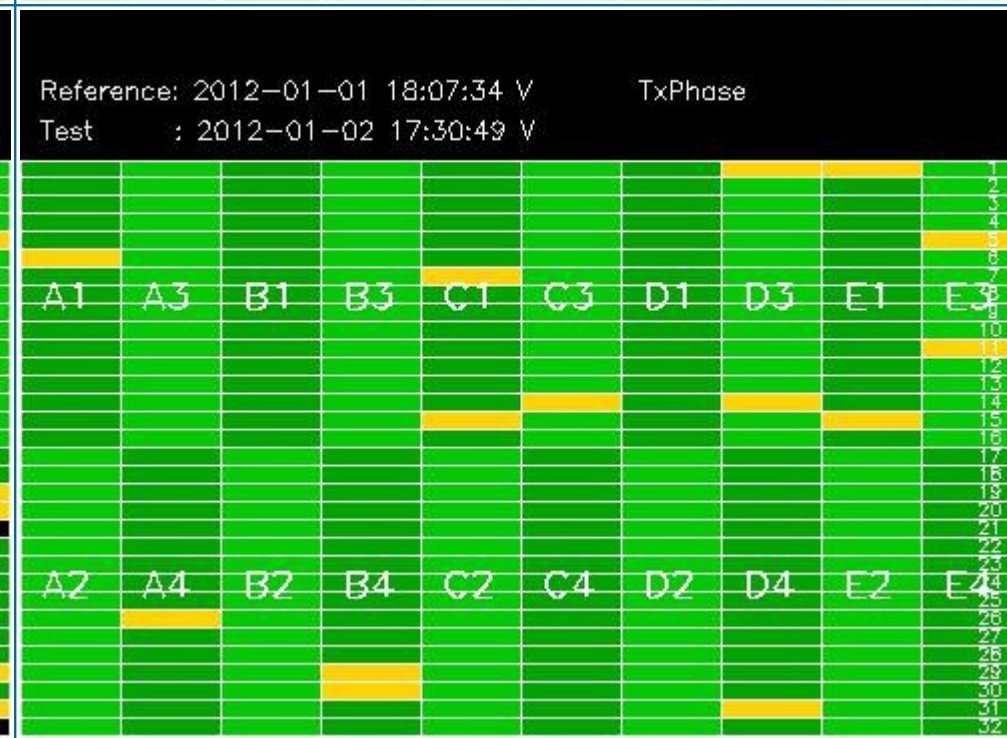
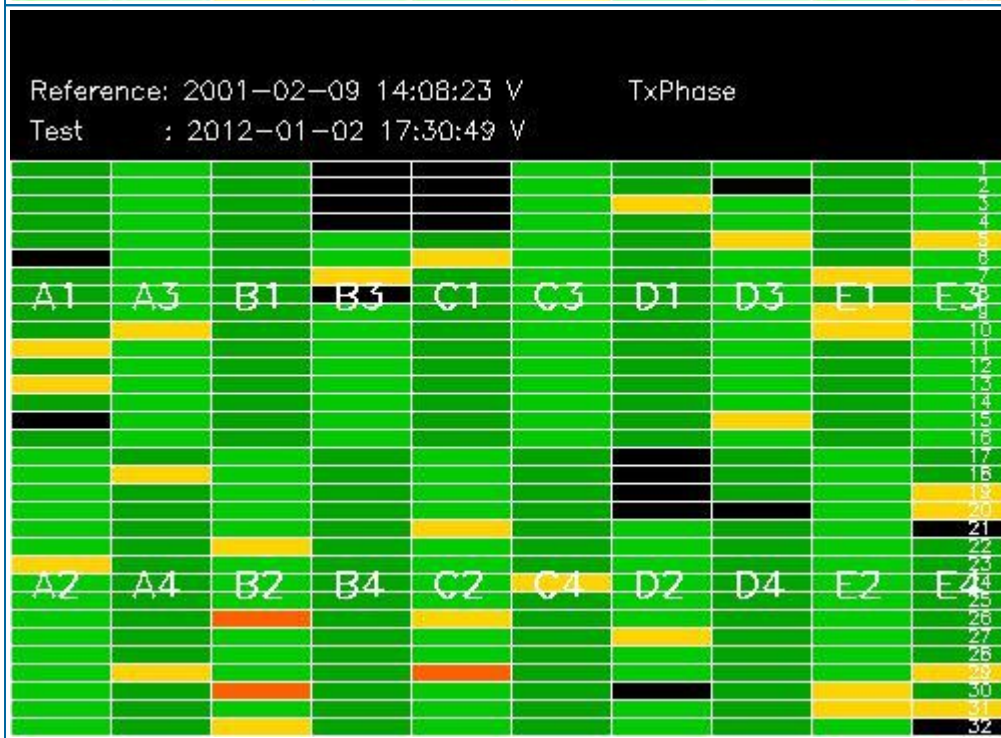
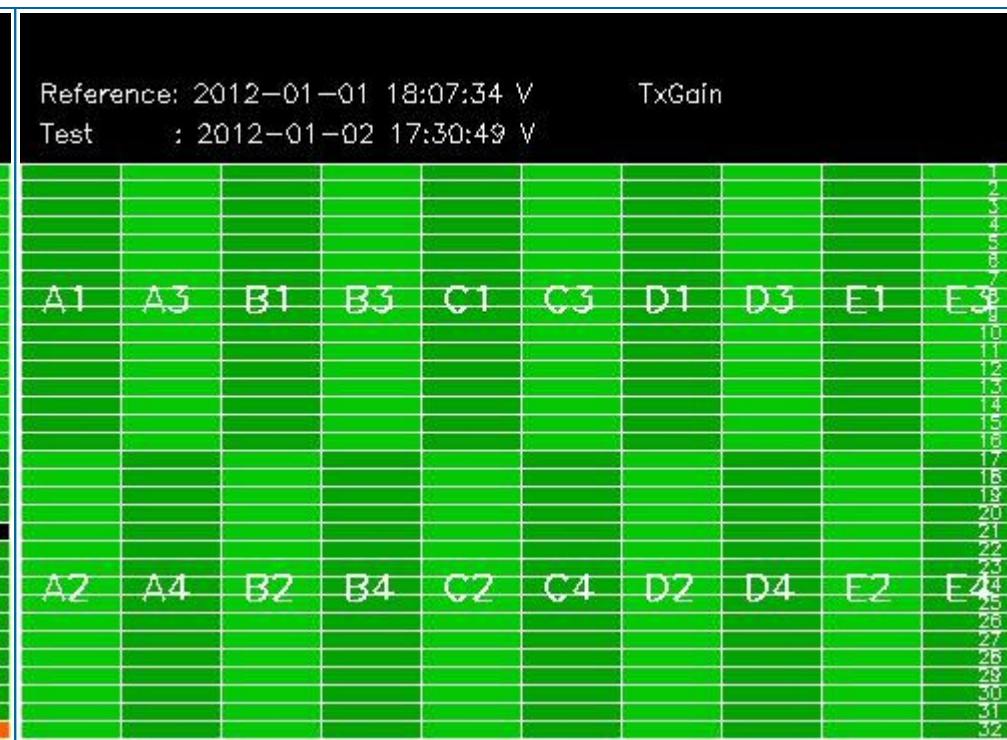
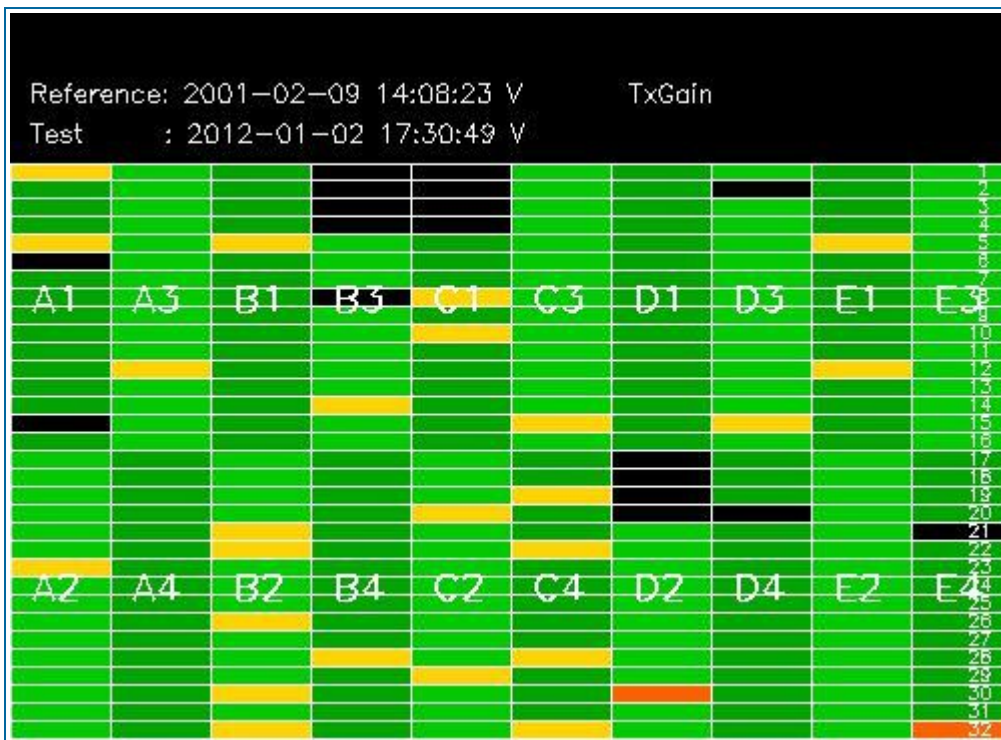


3.2 - H/H polarisation

[[BACK TO MENU](#)]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
Pre-launch reference (2001-02-09)	Previous product in the same polarisation

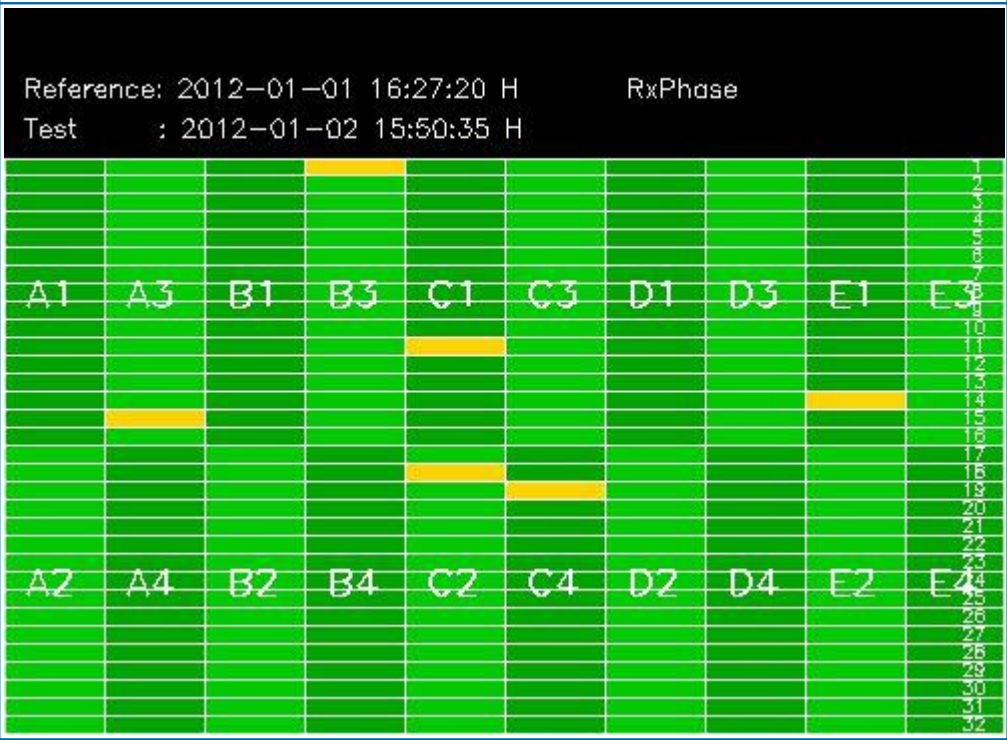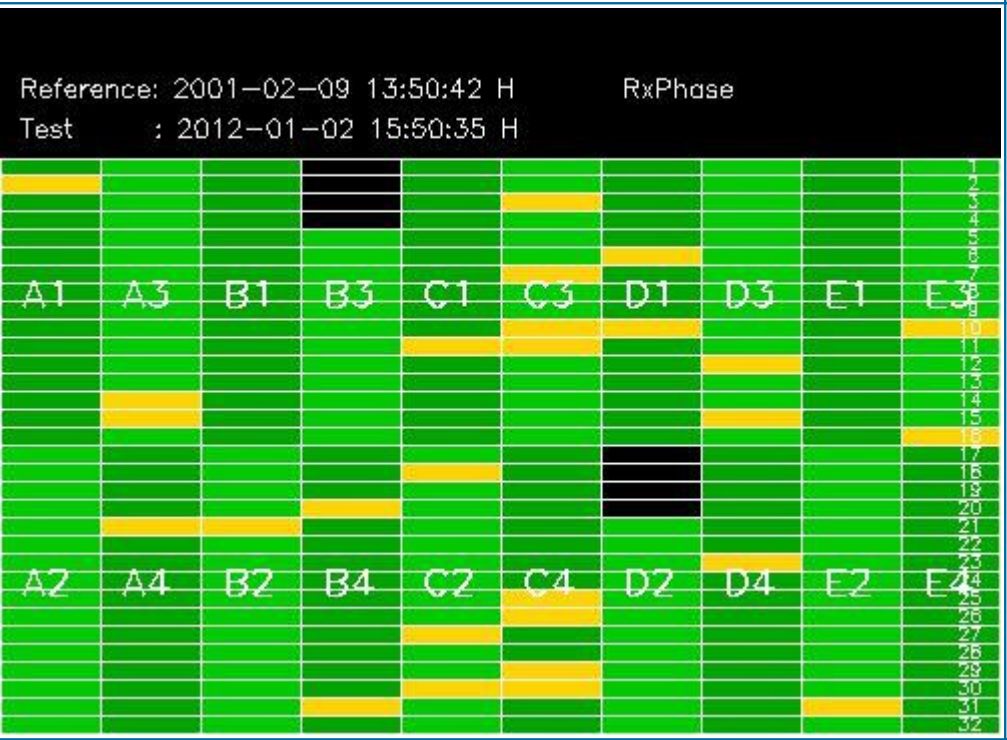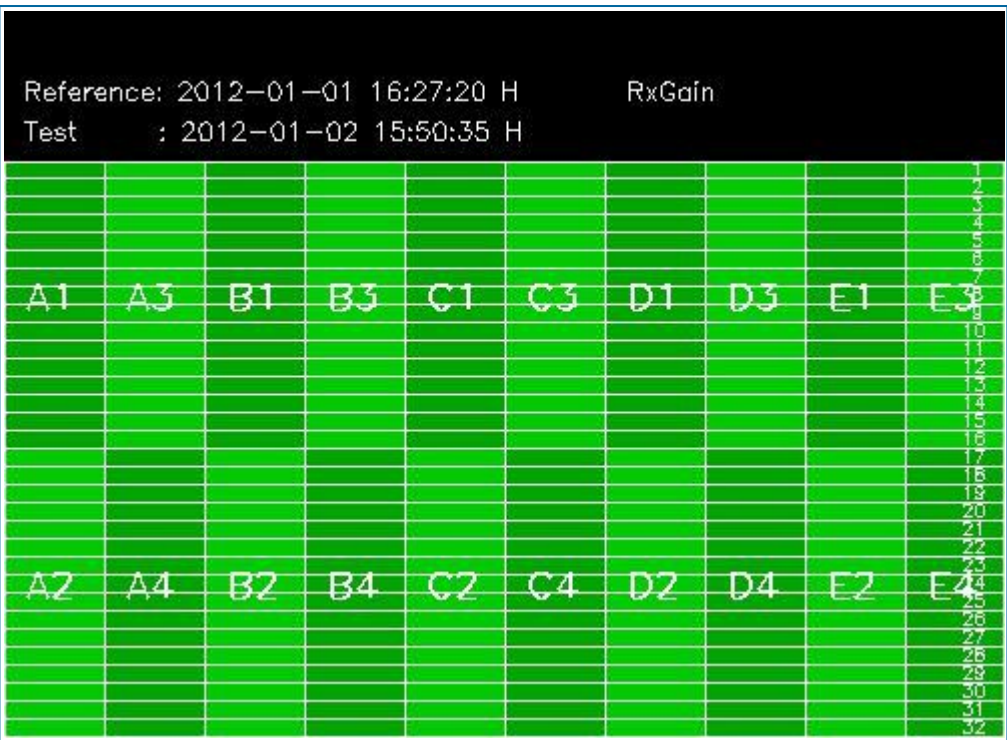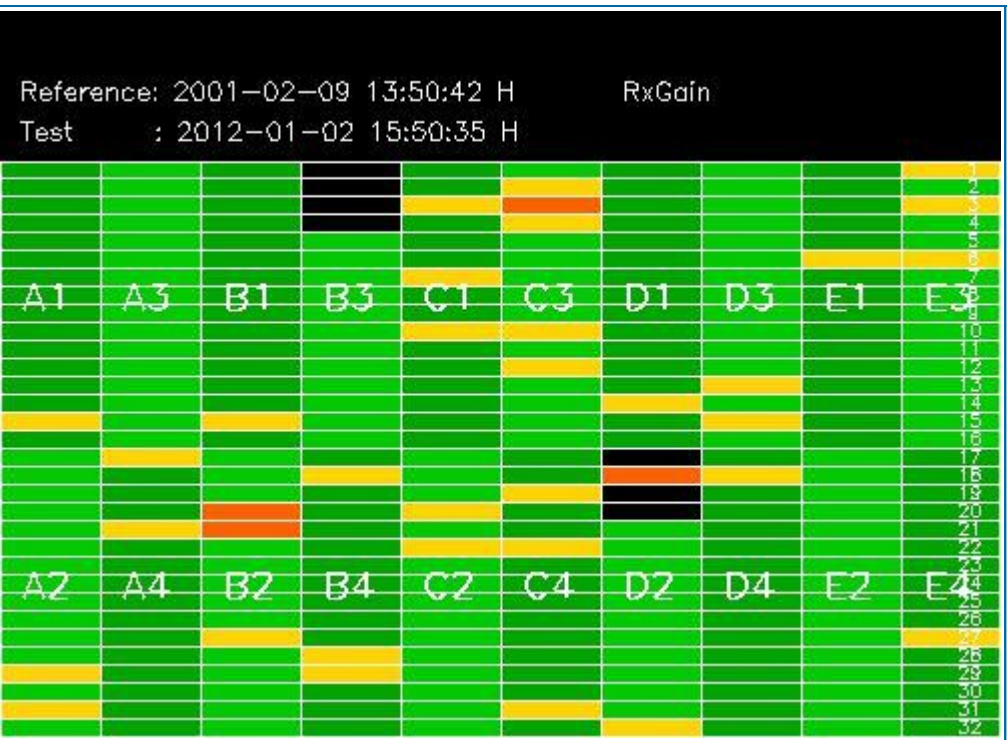

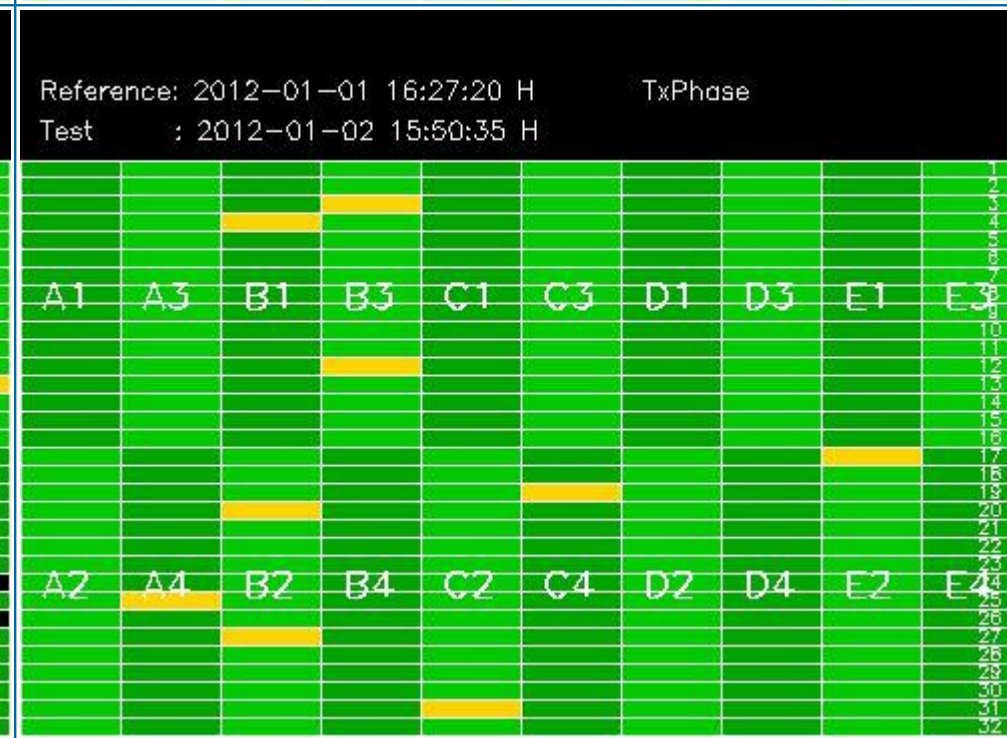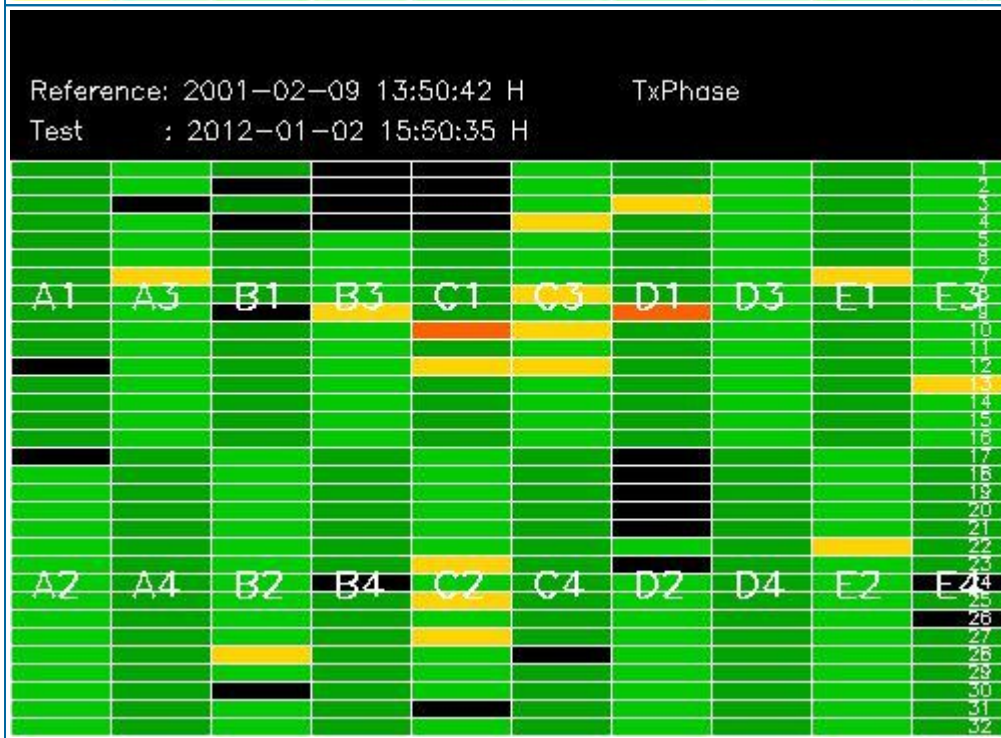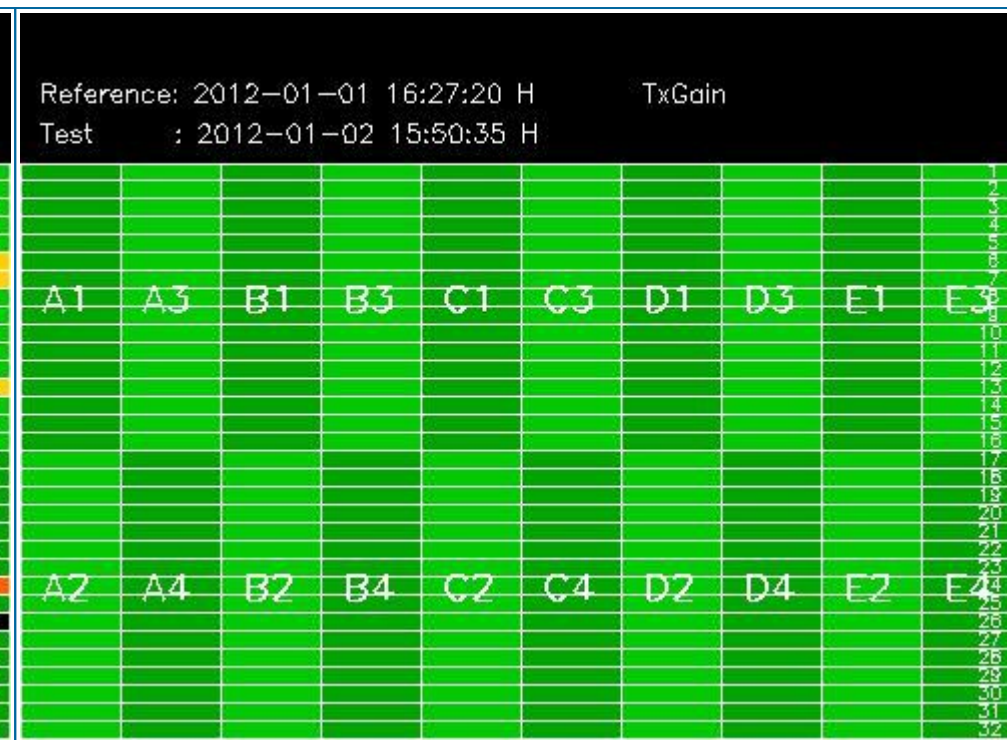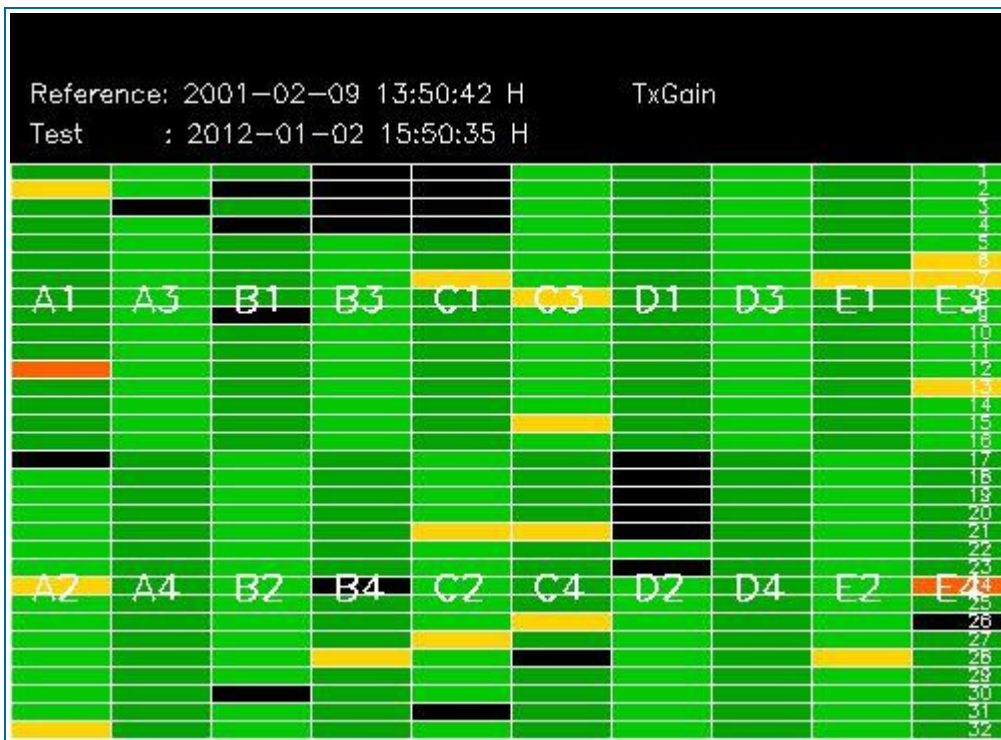

4 - CALIBRATION PULSES ANALYSIS

4.1 - Analysis for WVS IS2 V/V


4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for WVS IS2 V/V

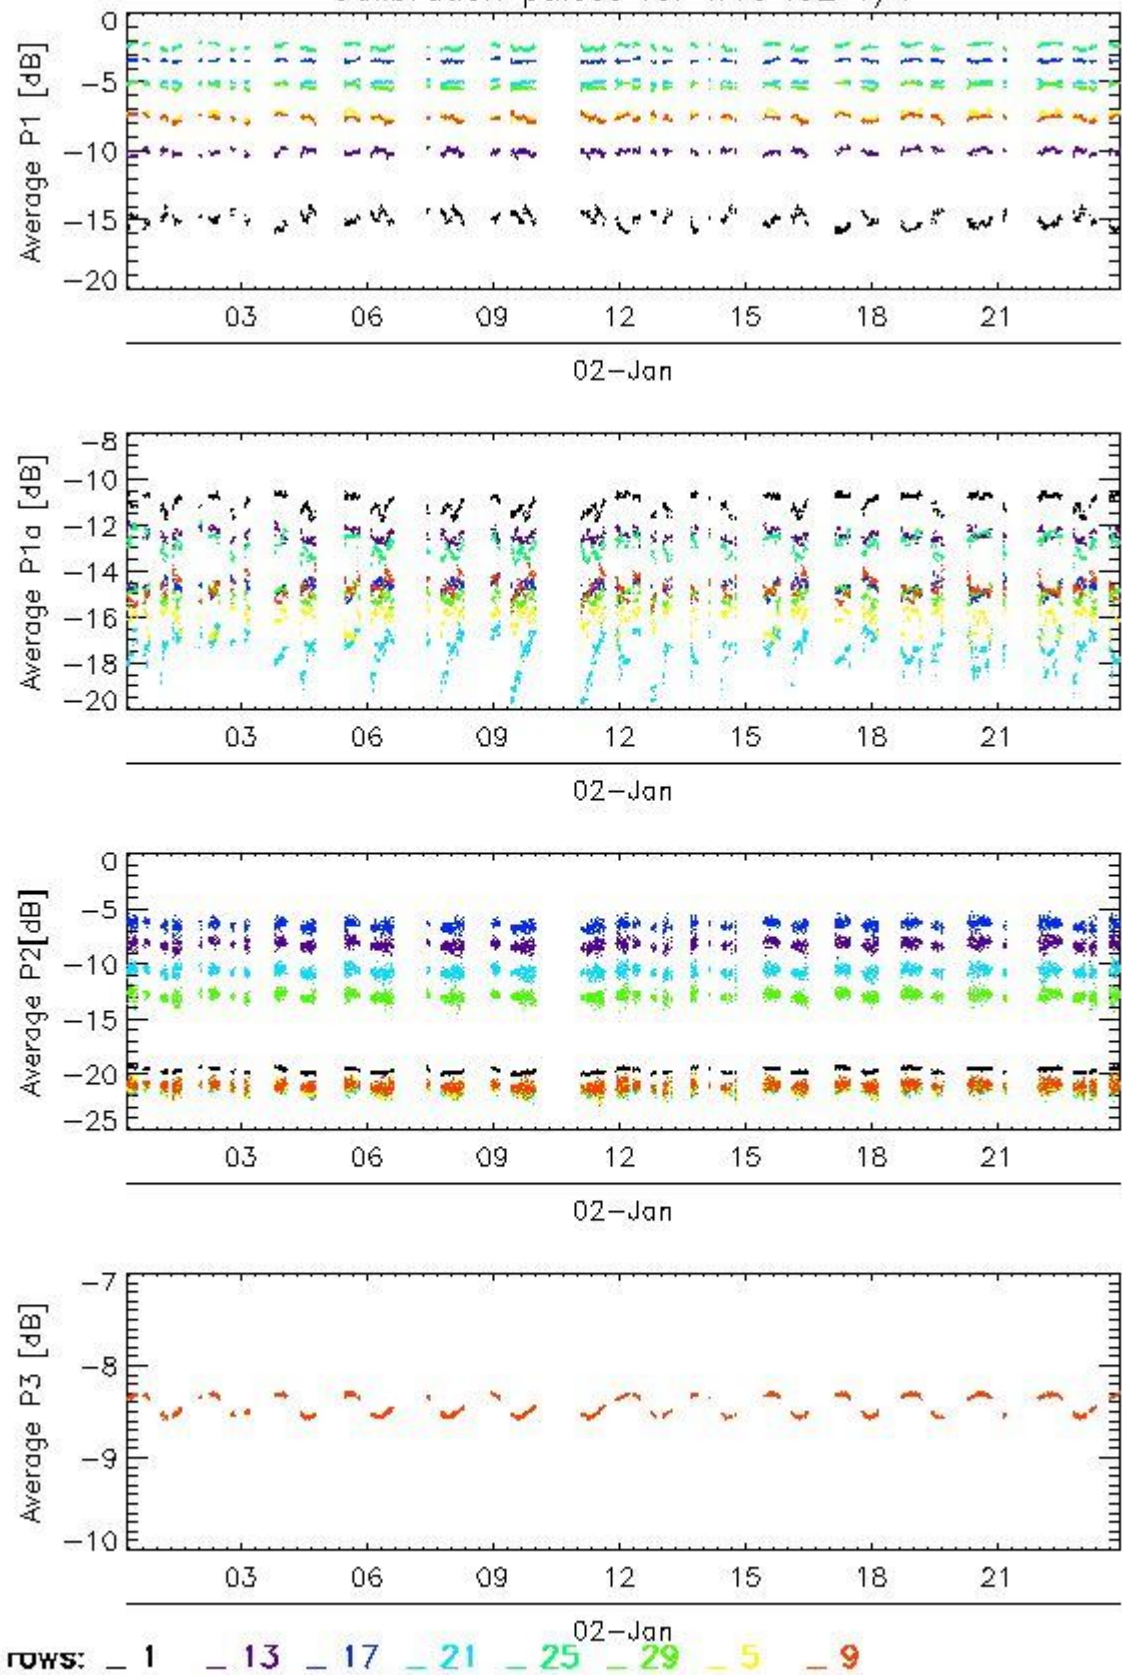


Transmit power (P1 - P1a) for WVS IS2 V/V

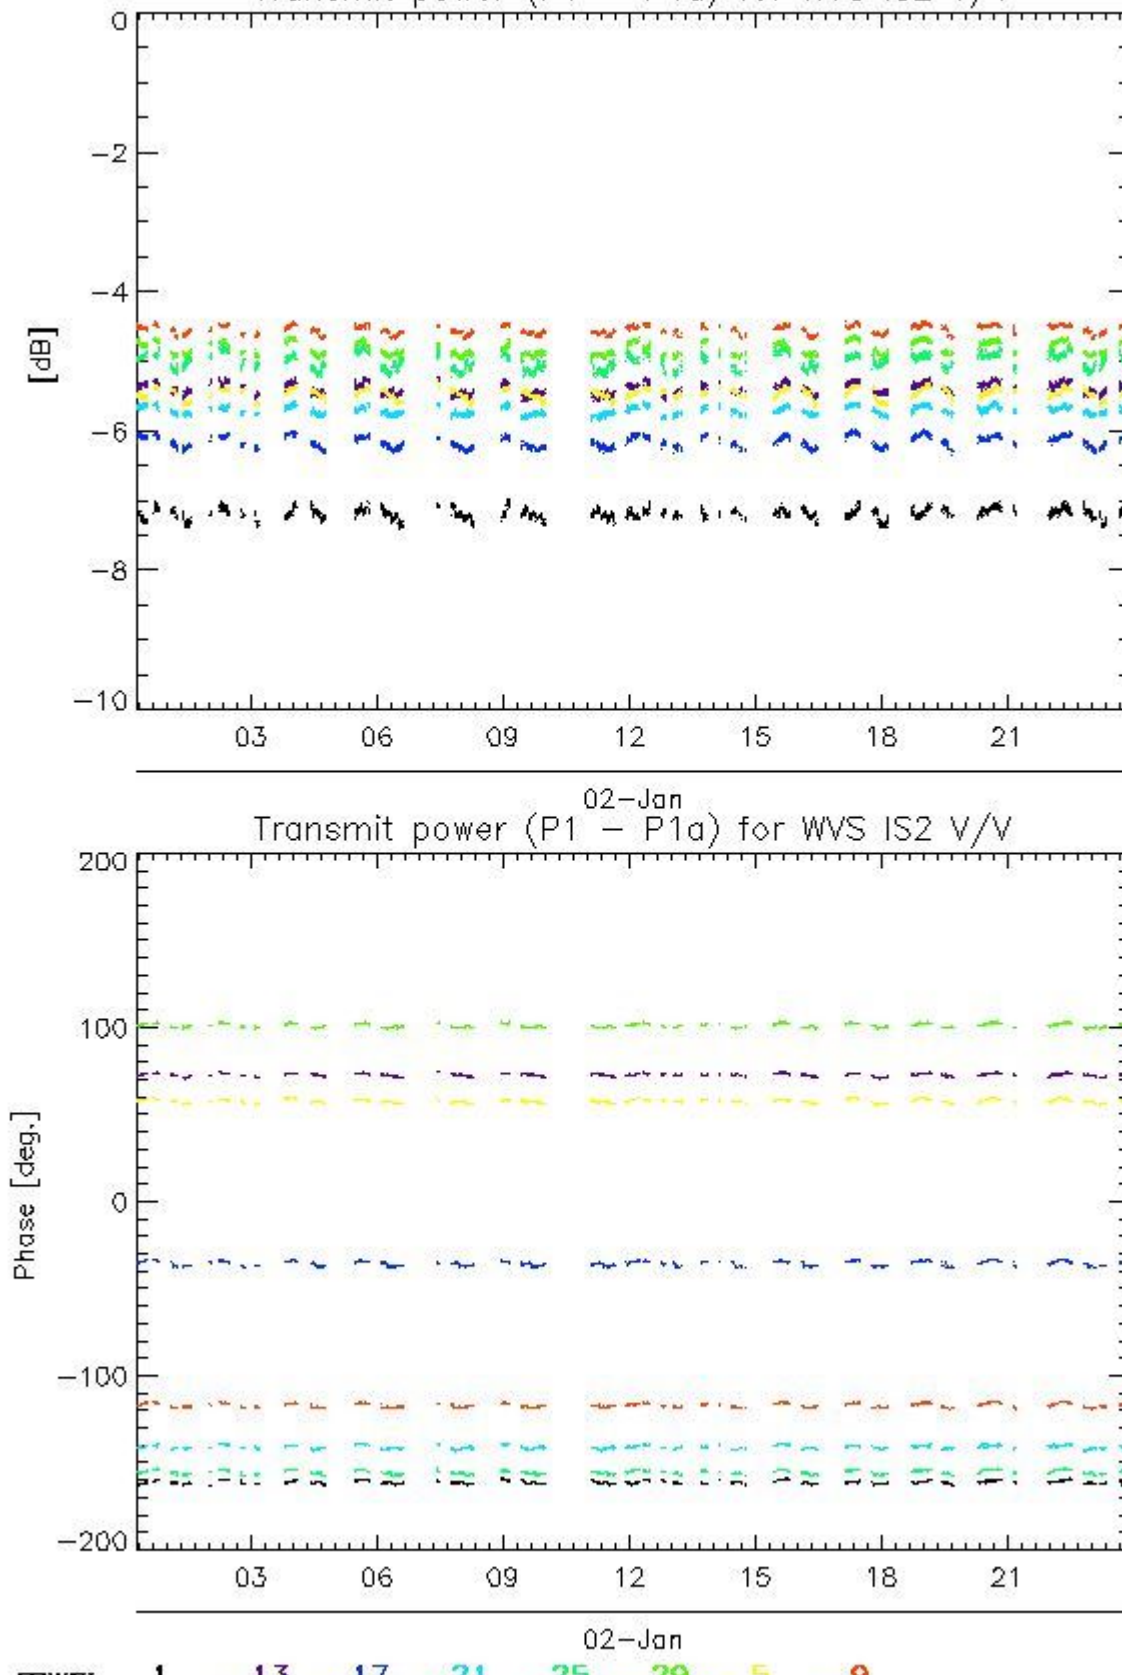

4.1.2 - All Rows Analysis for WVS IS2 V/V

[BACK TO MENU]



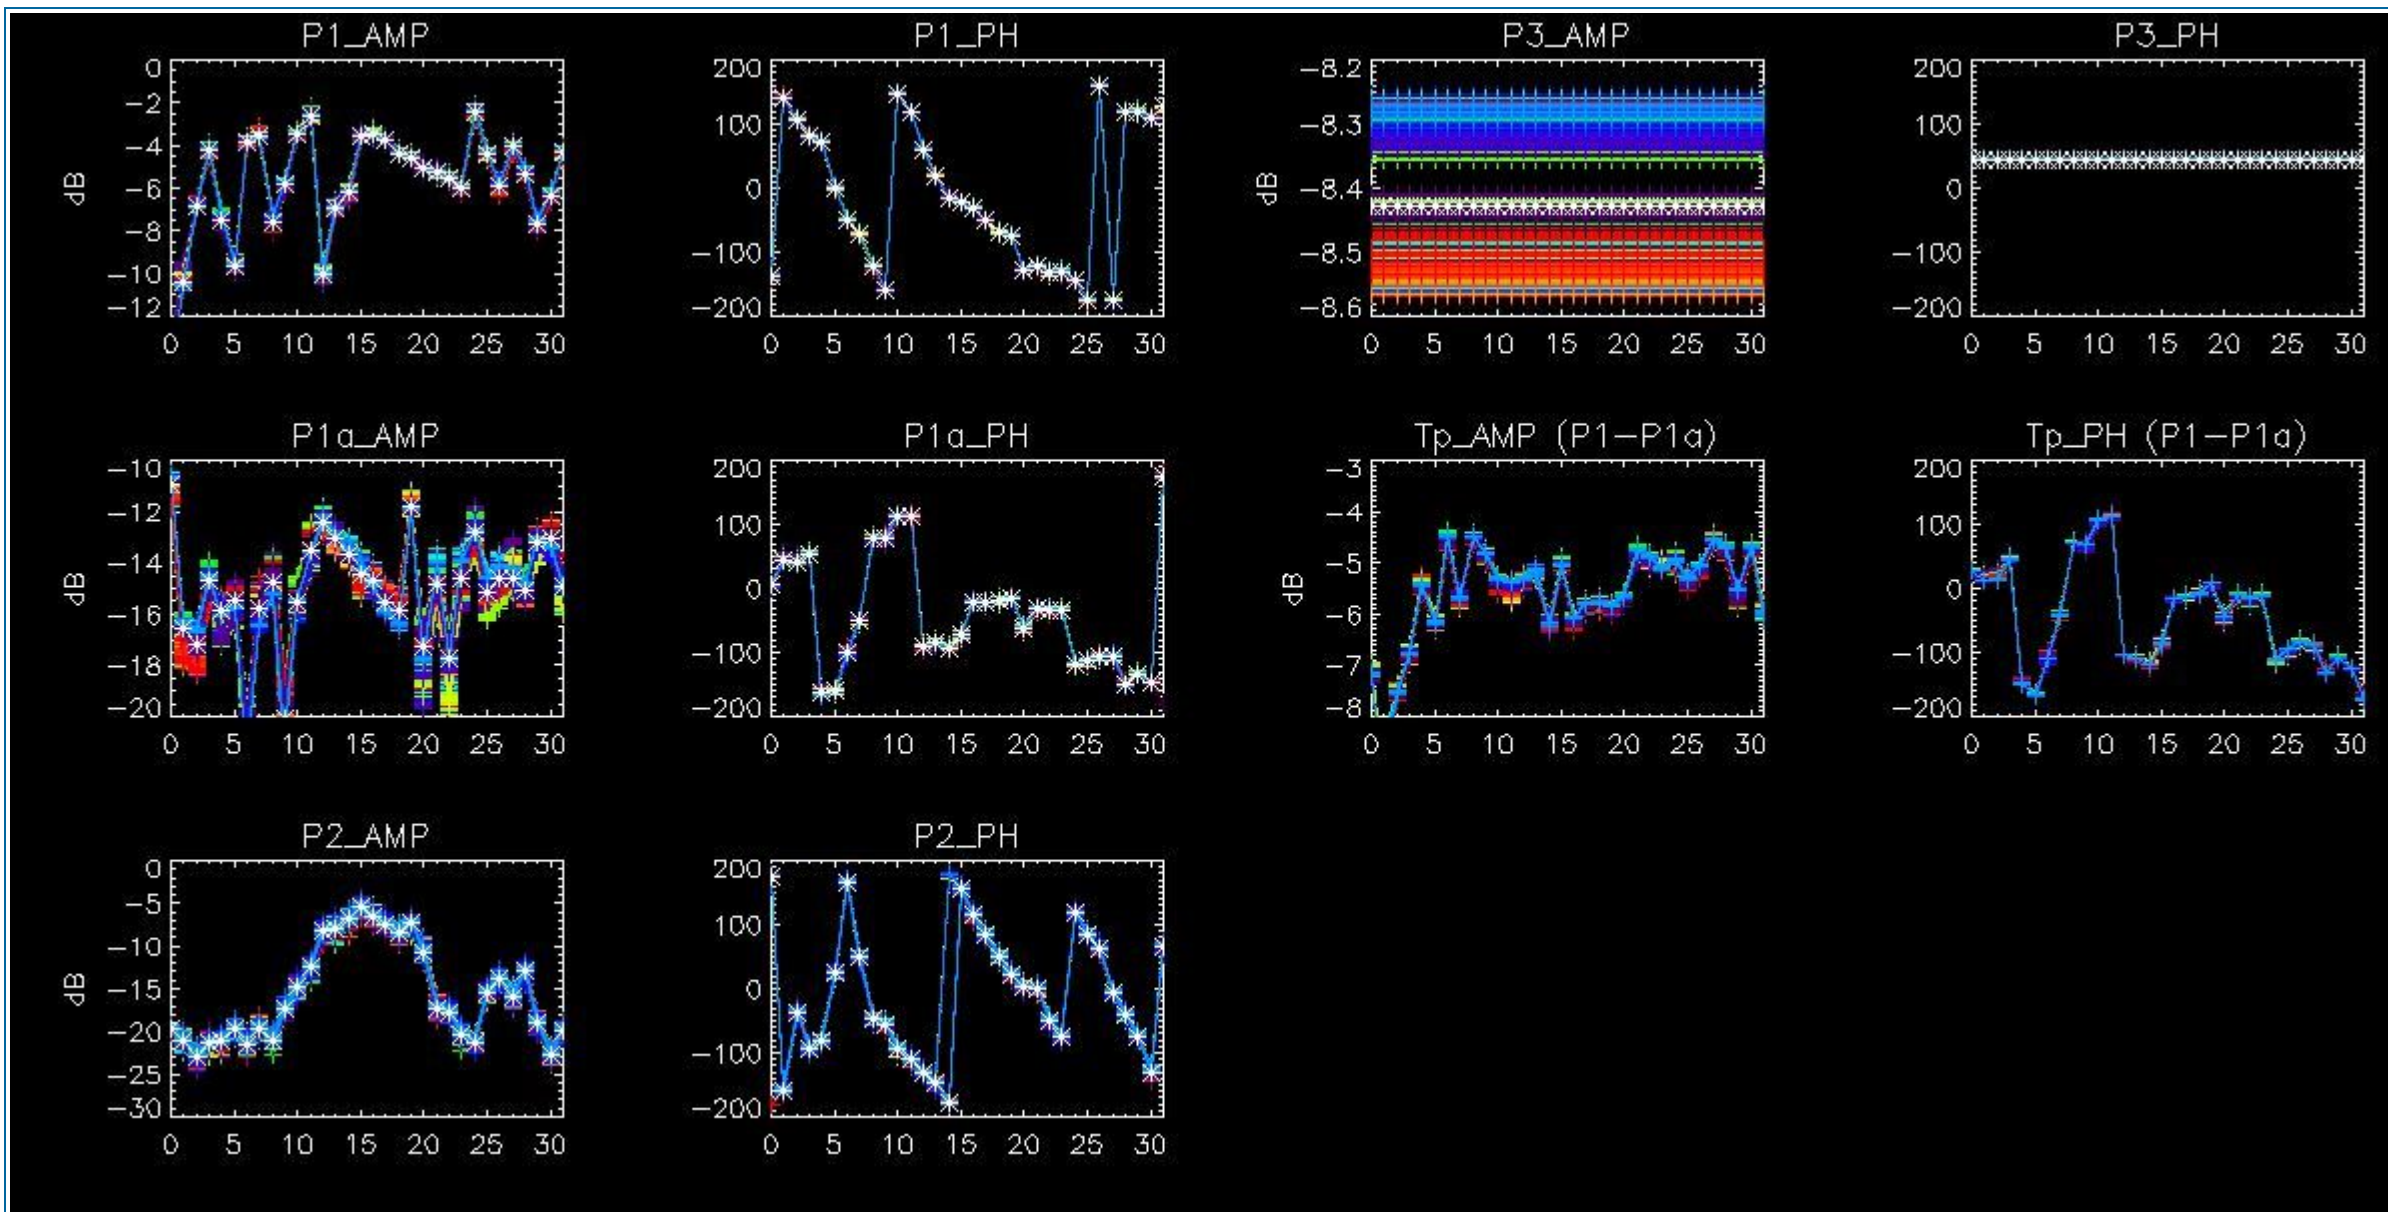

4.2 - Analysis for GM1 SS3 H/H


4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for GM1 SS3 H/H

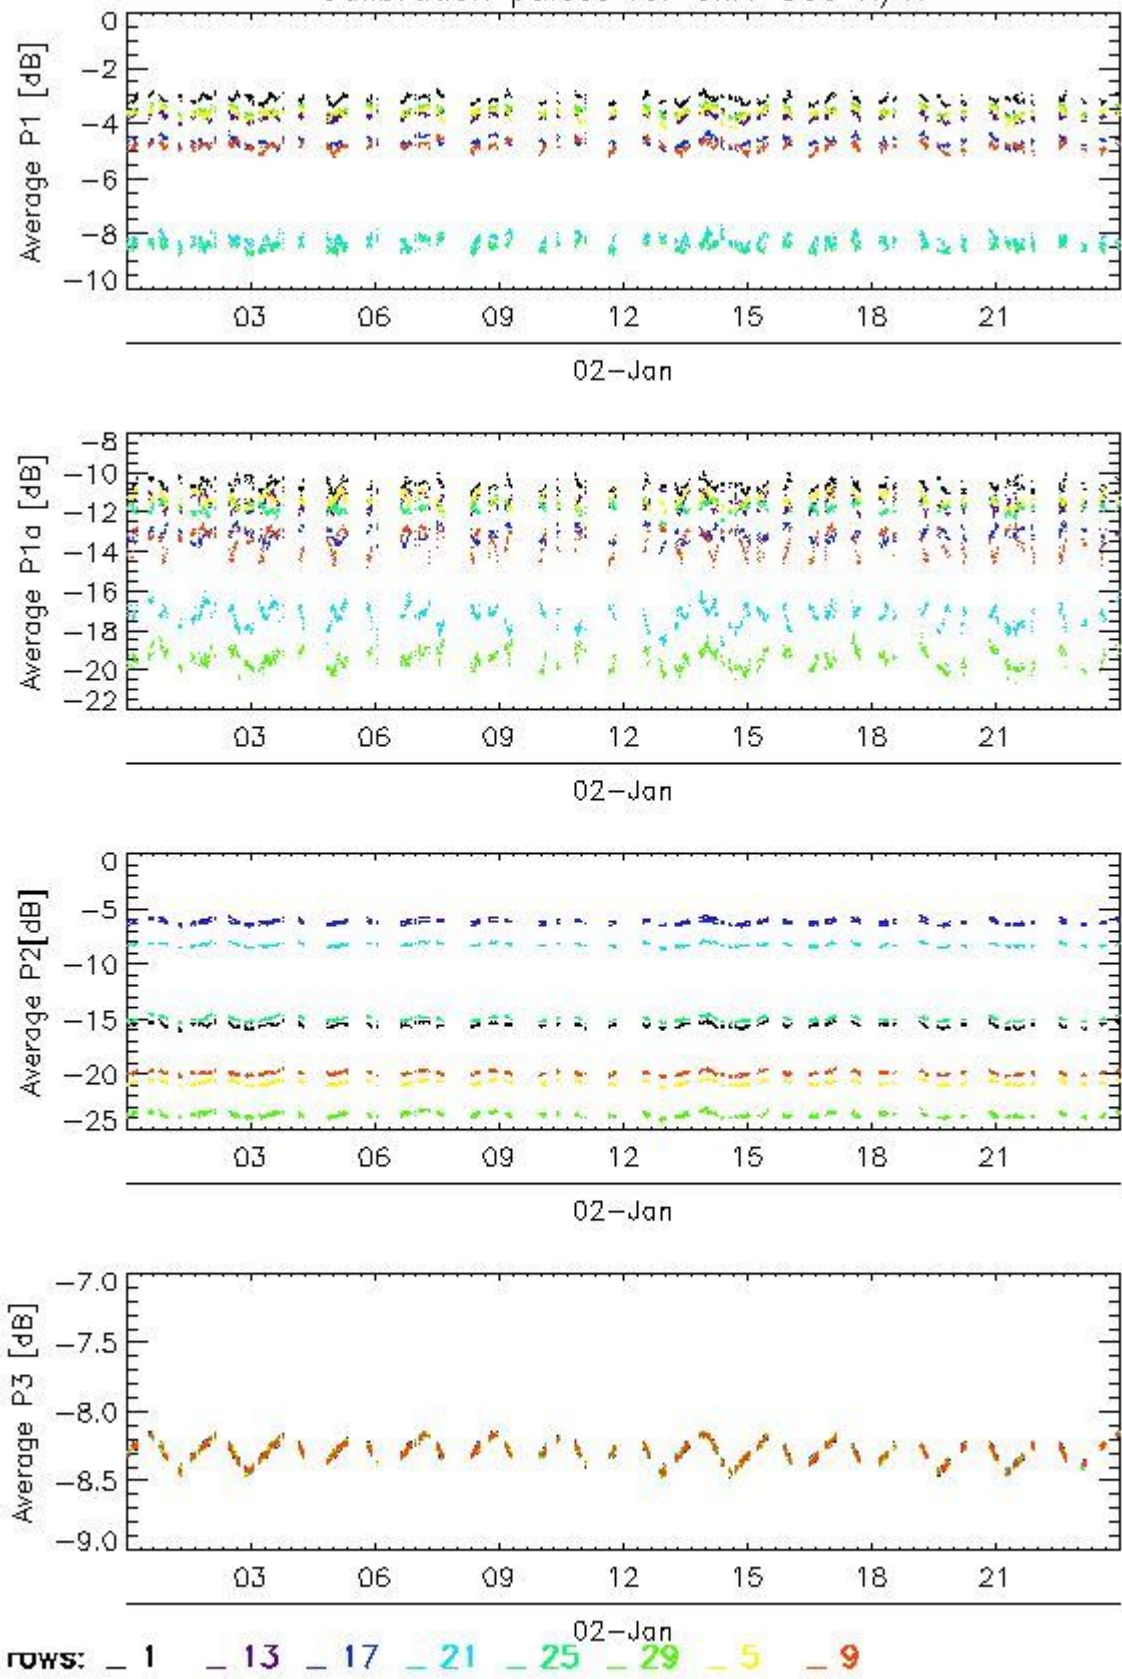


Transmit power (P1 - P1a) for GM1 SS3 H/H

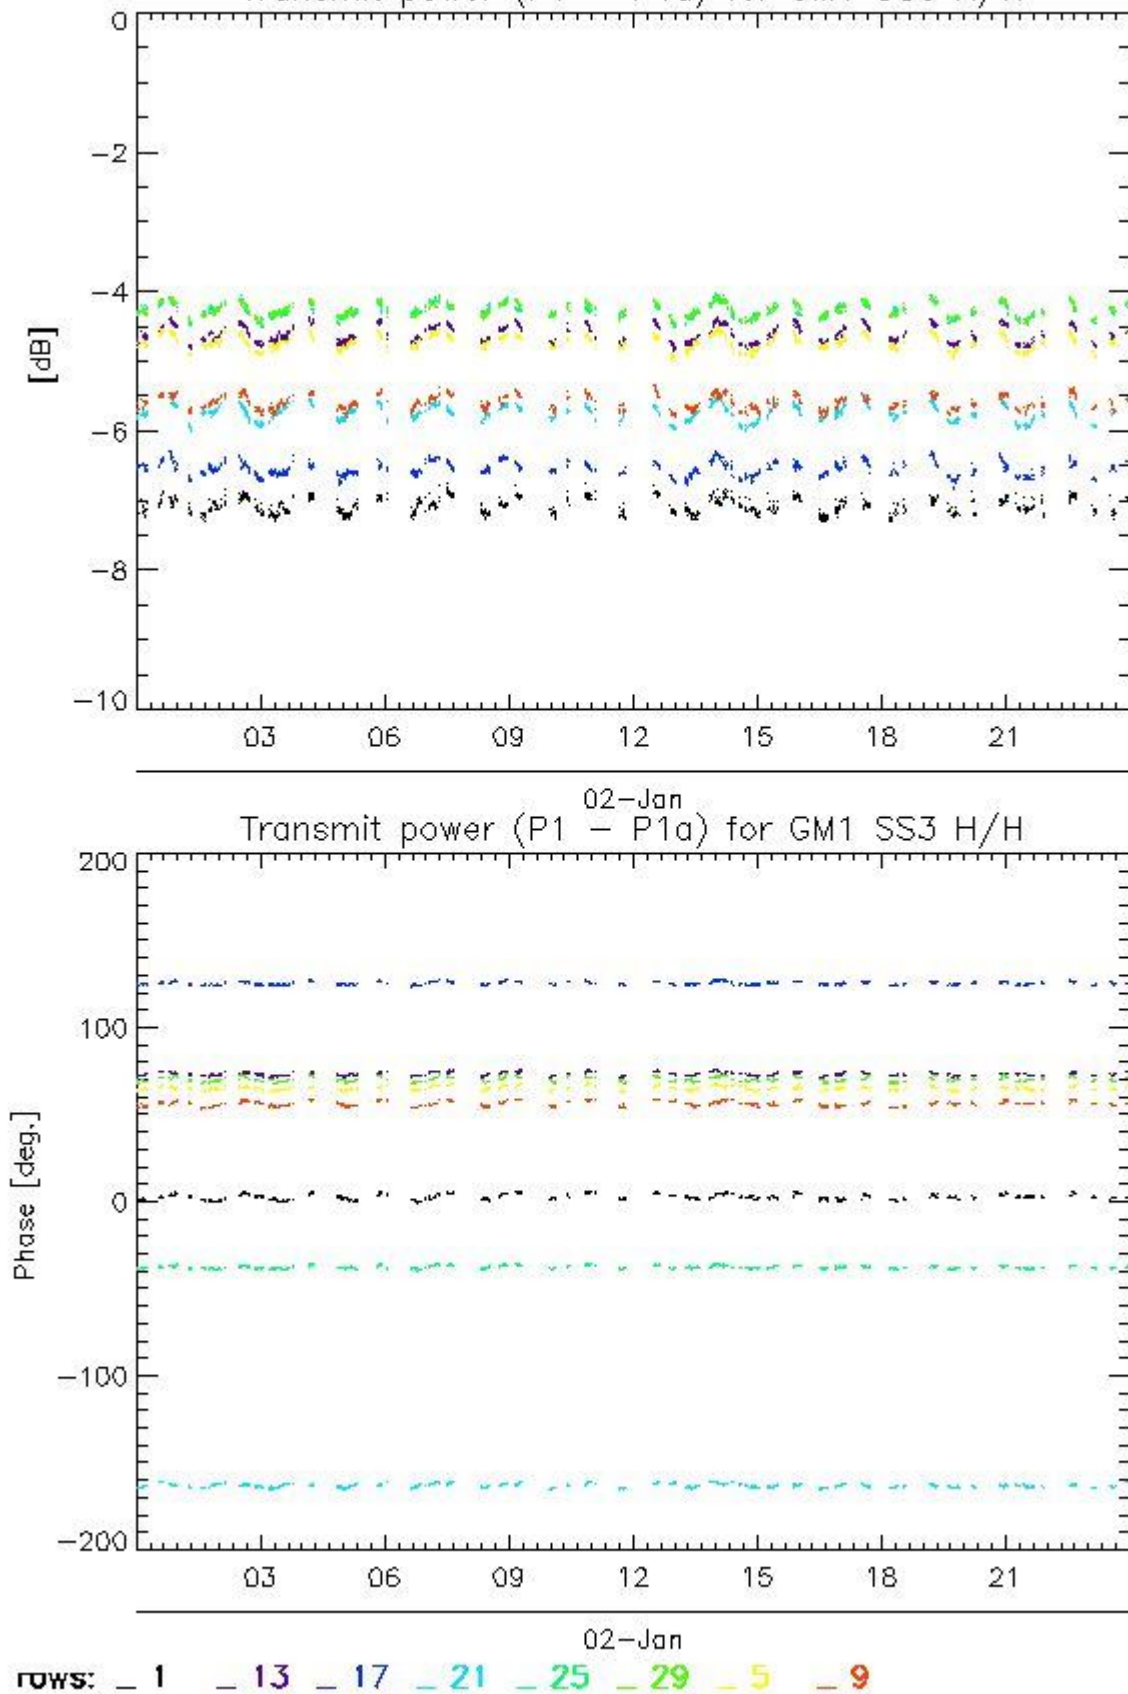

4.2.2 - All Rows Analysis for GM1 SS3 H/H

[[BACK TO MENU](#)]



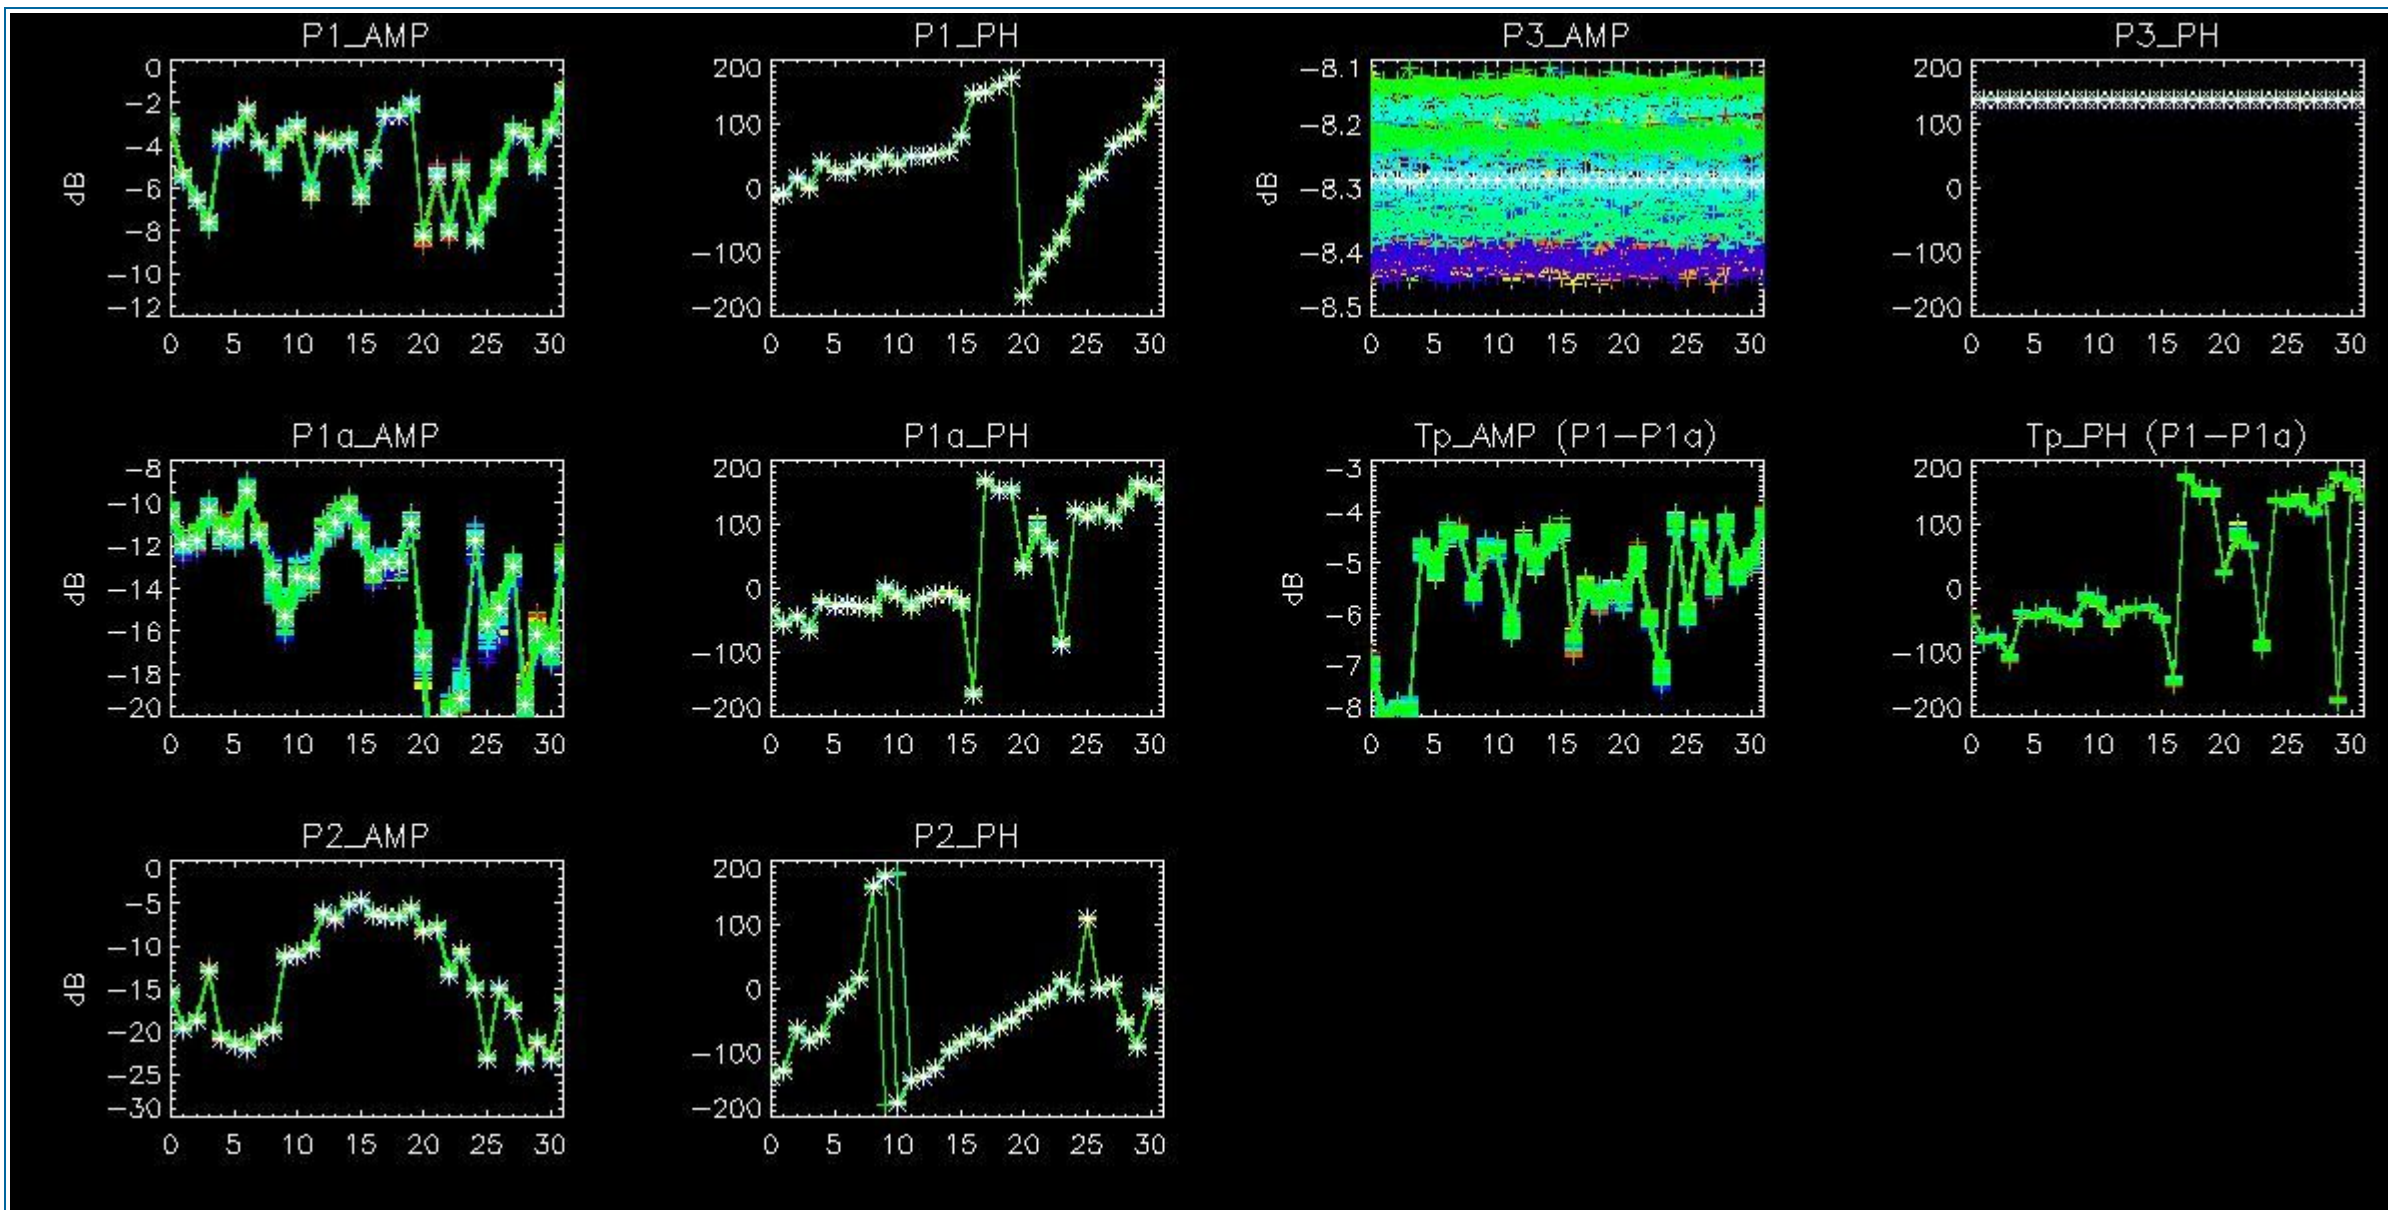


5 - DOPPLER ANALYSIS

5.1 - Analysis for WVS IS2 V/V

5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]




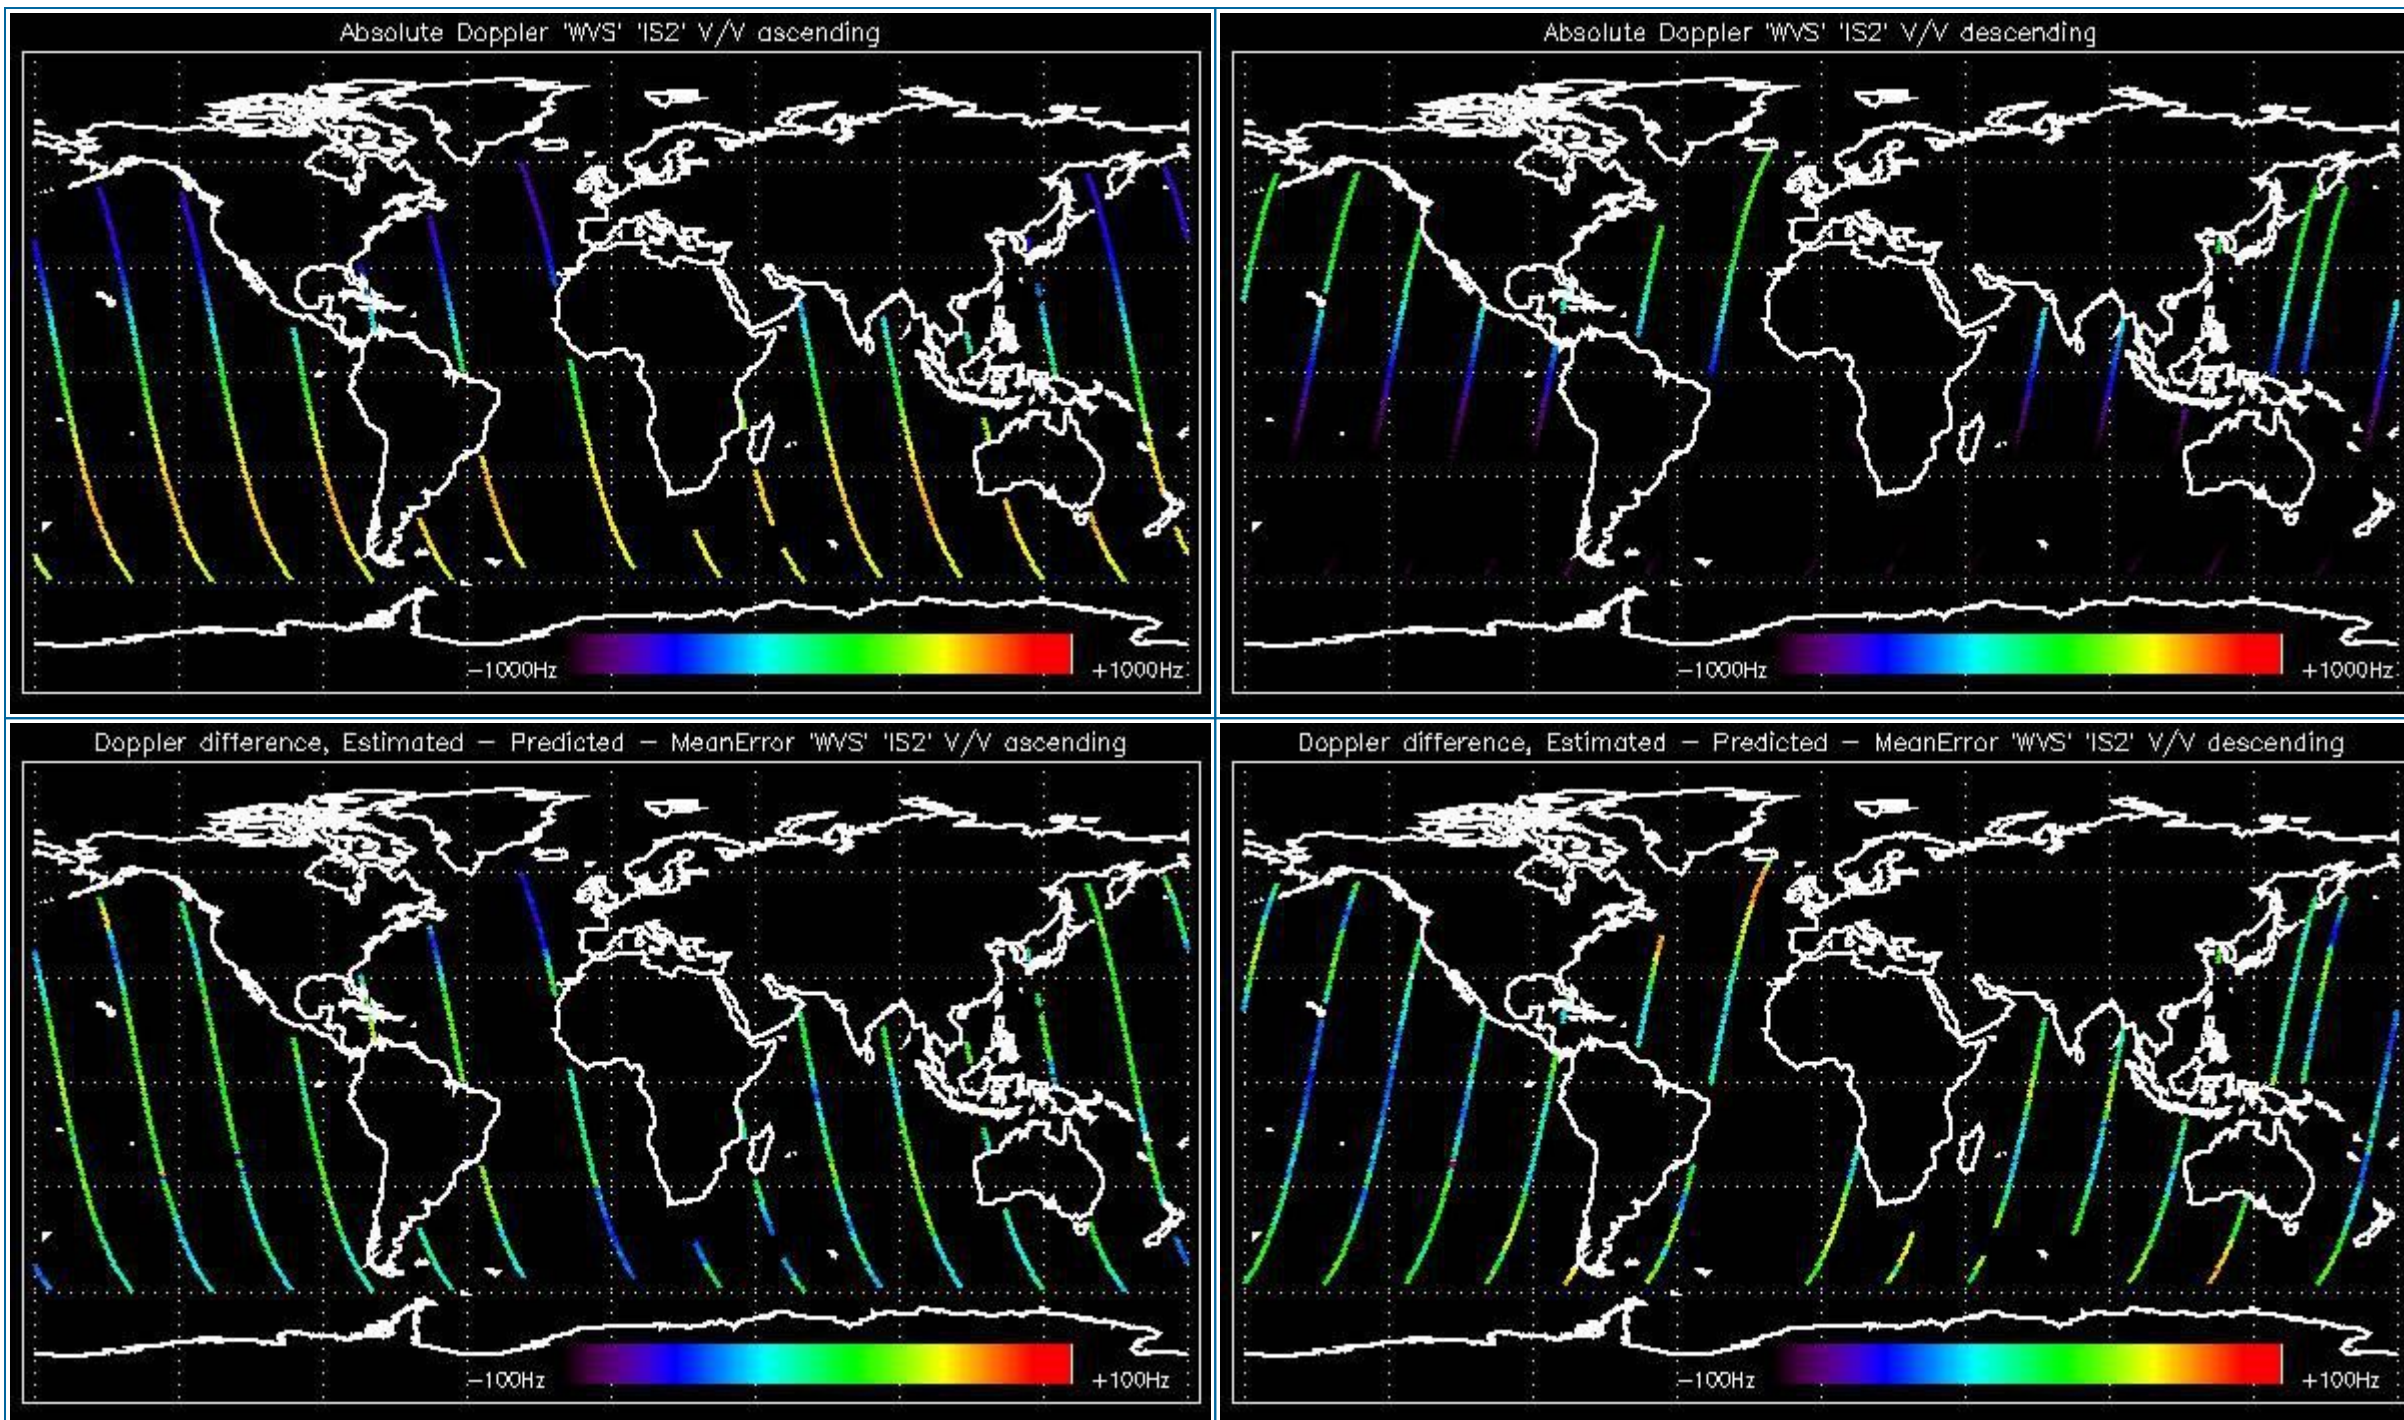

5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



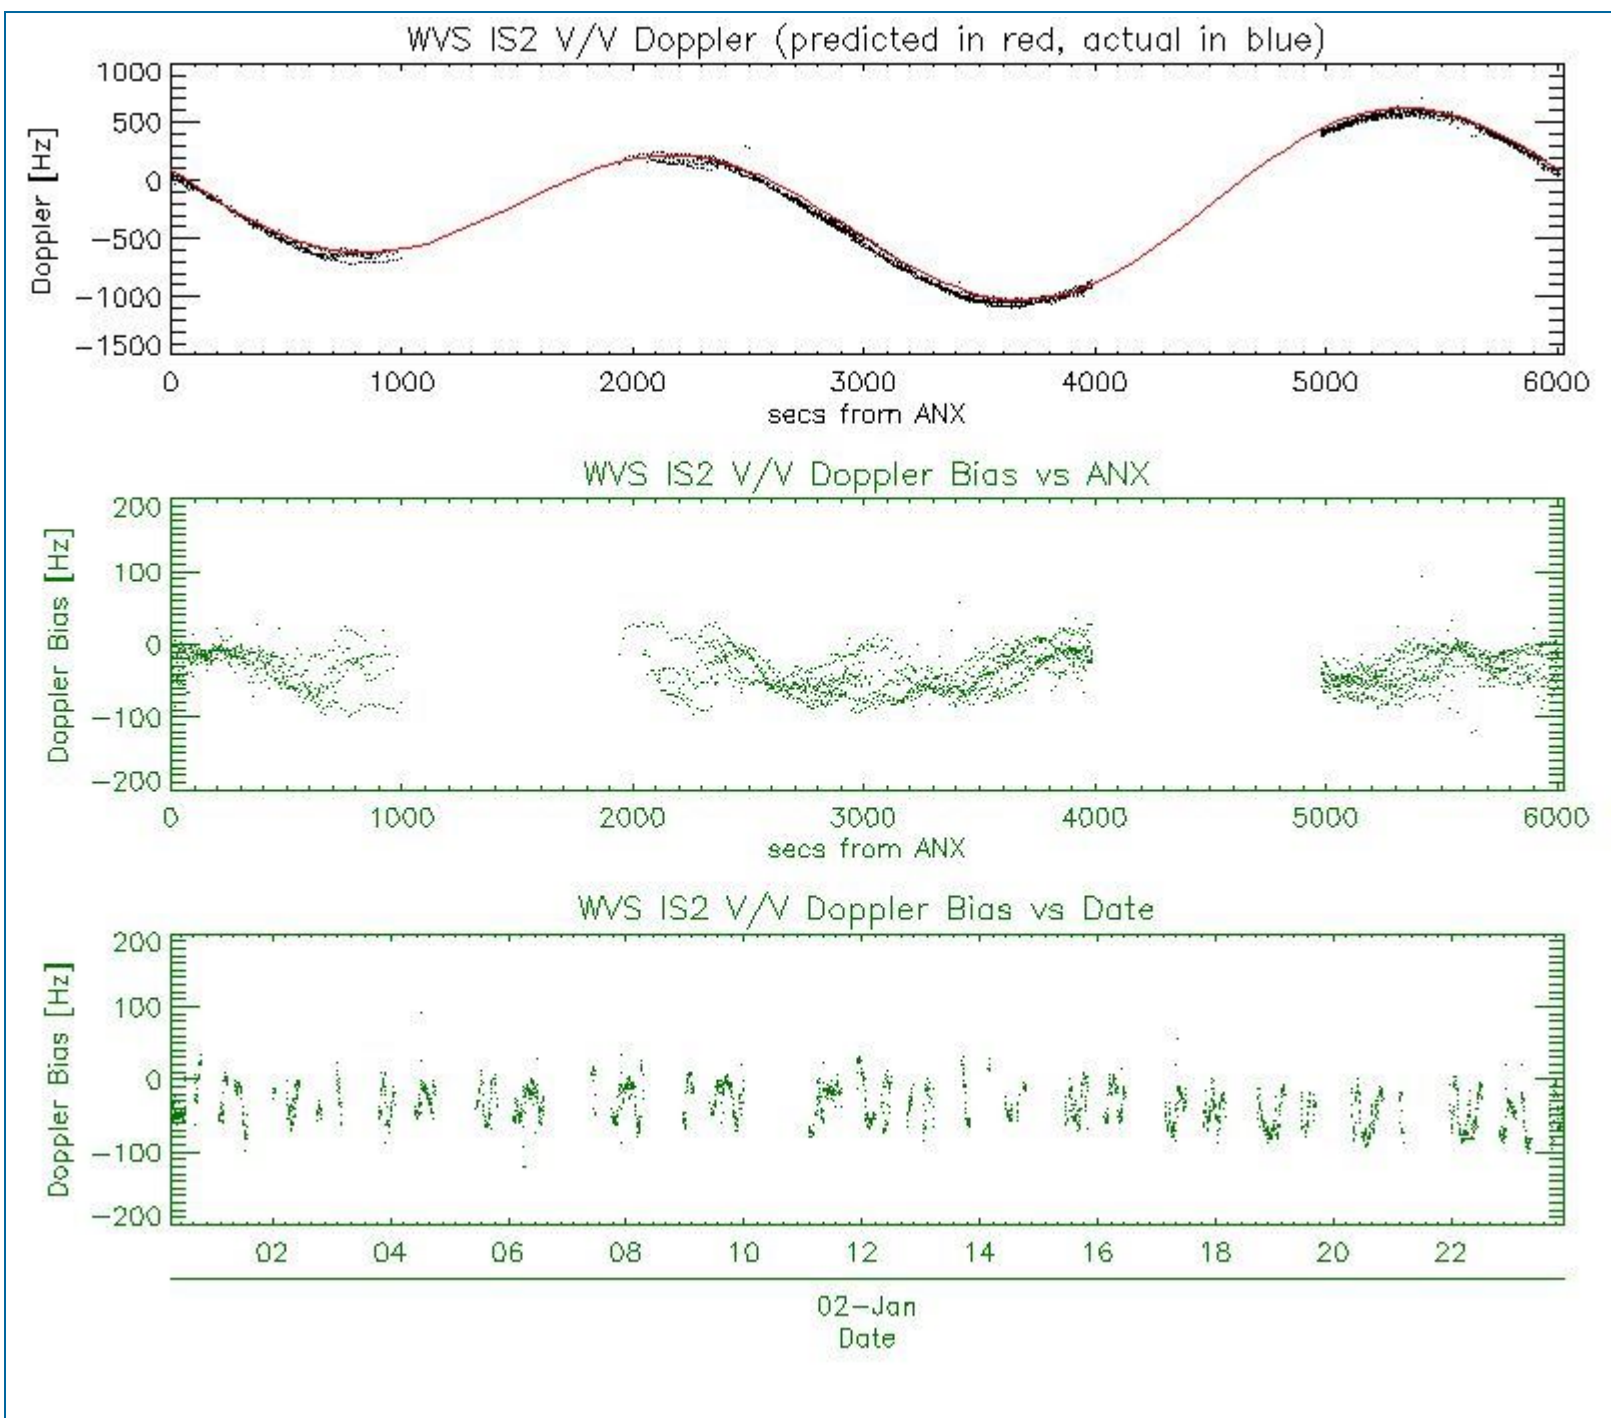


5.2 - Analysis for GM1 SS1 H/H

5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




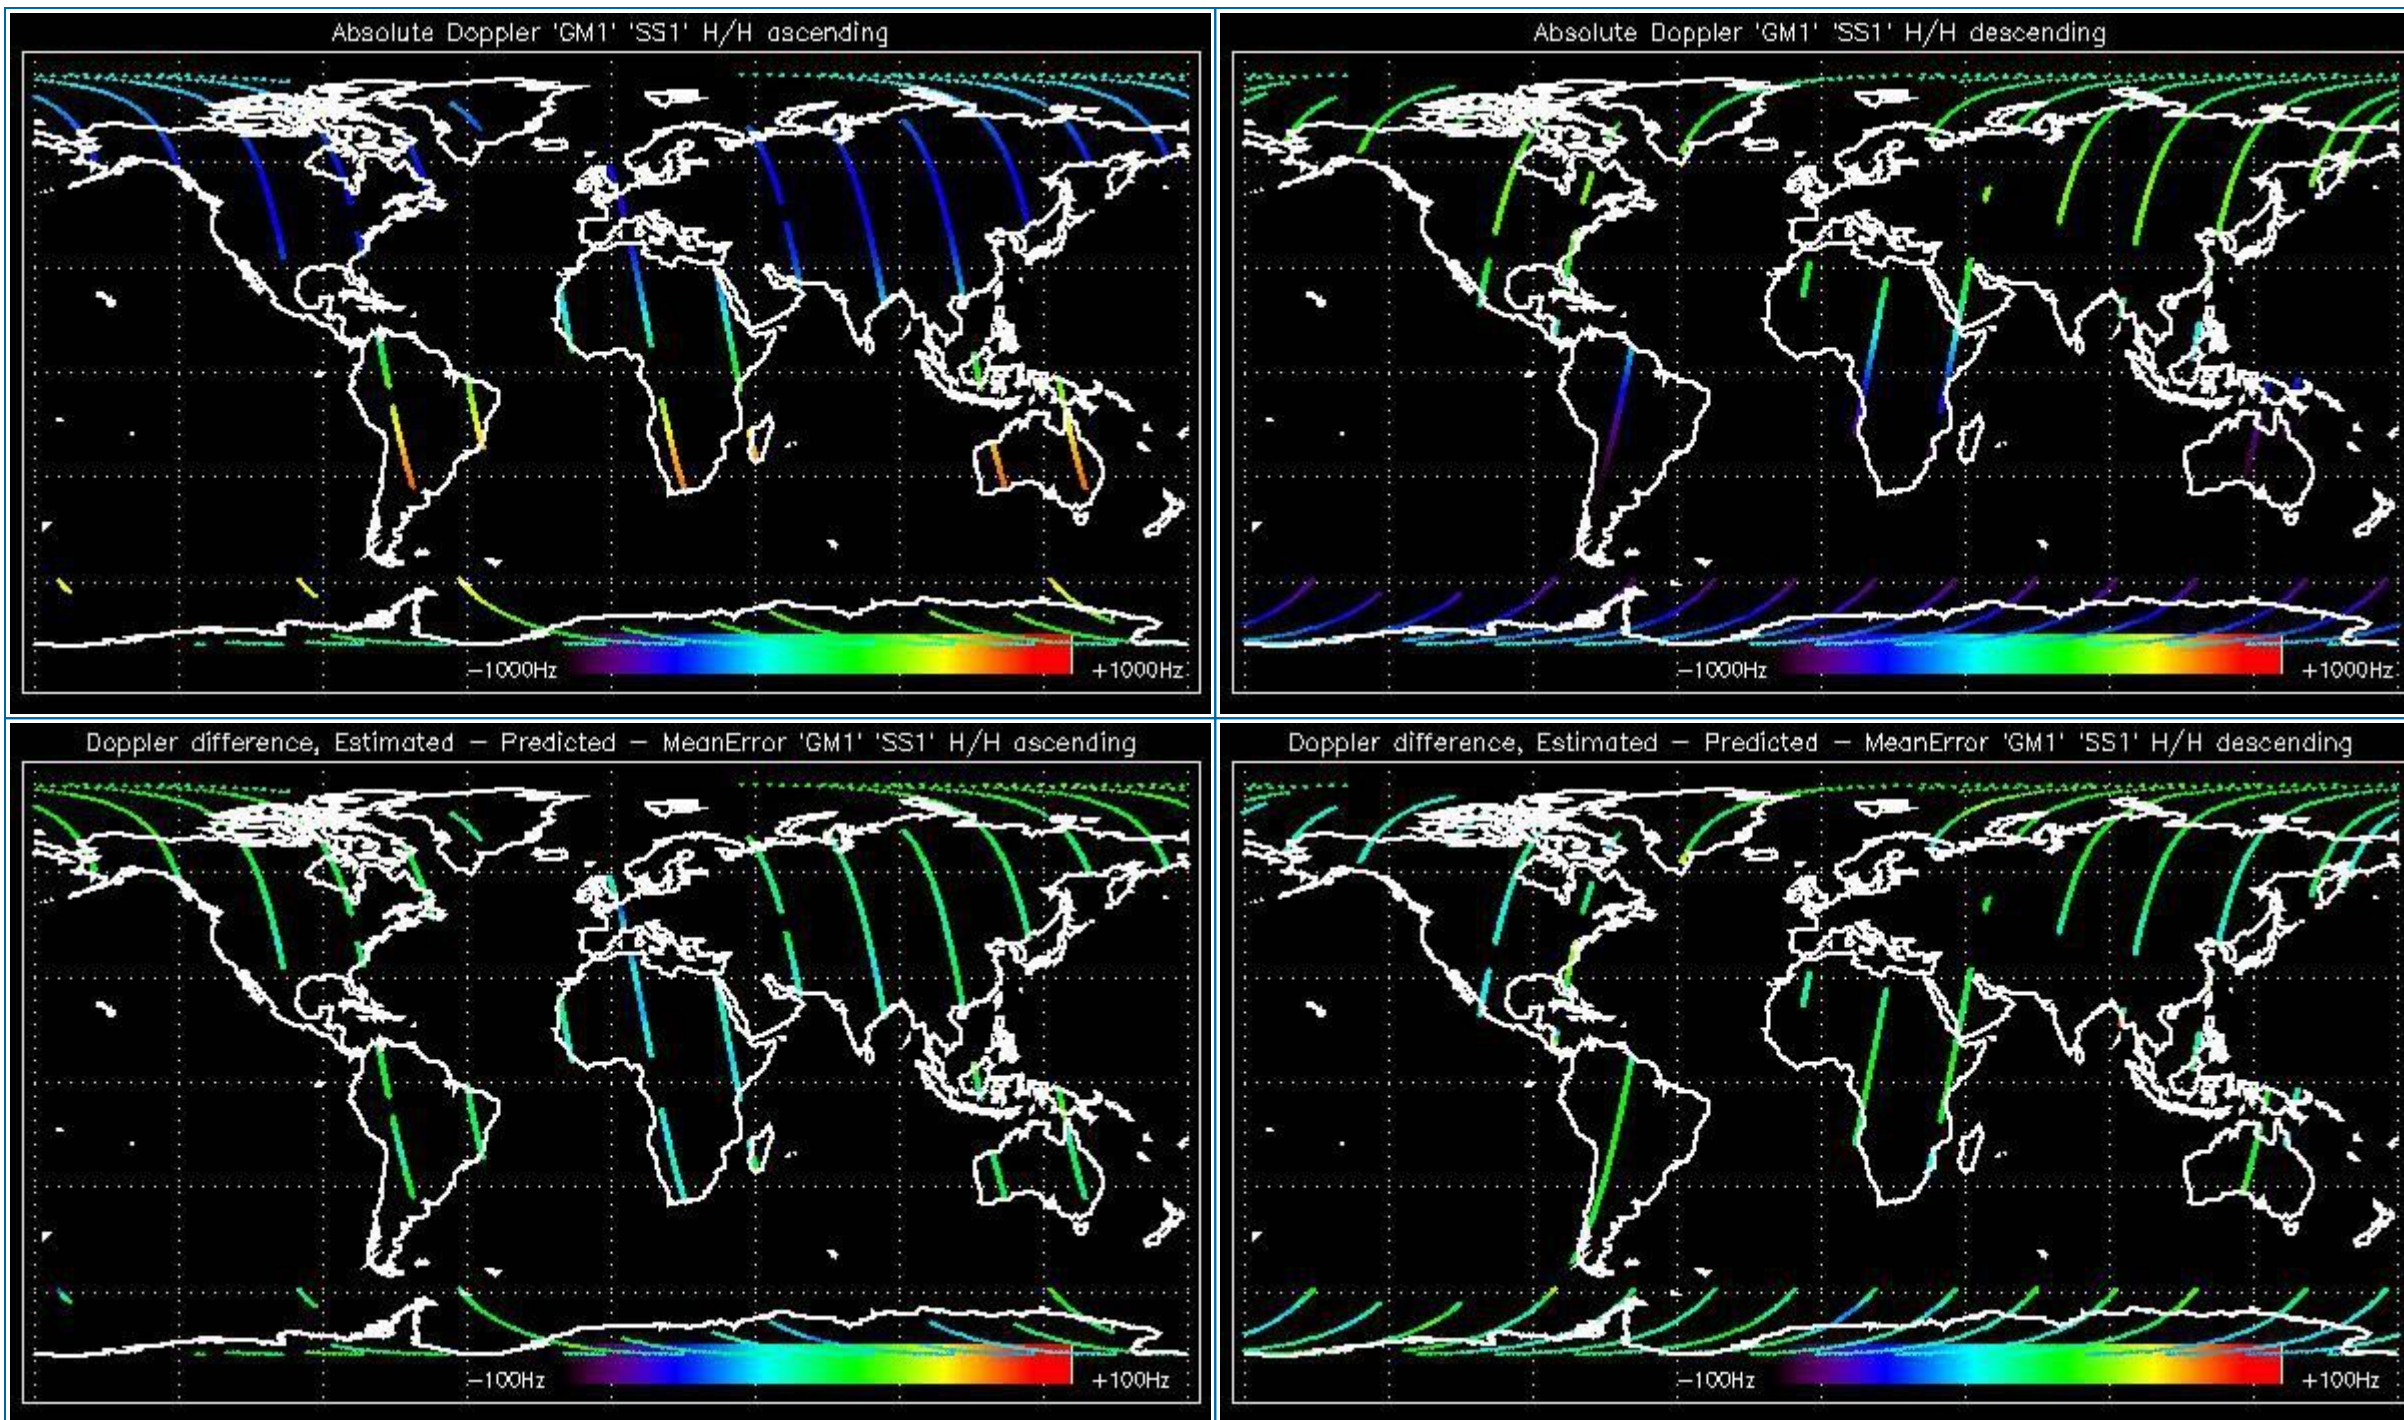

5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




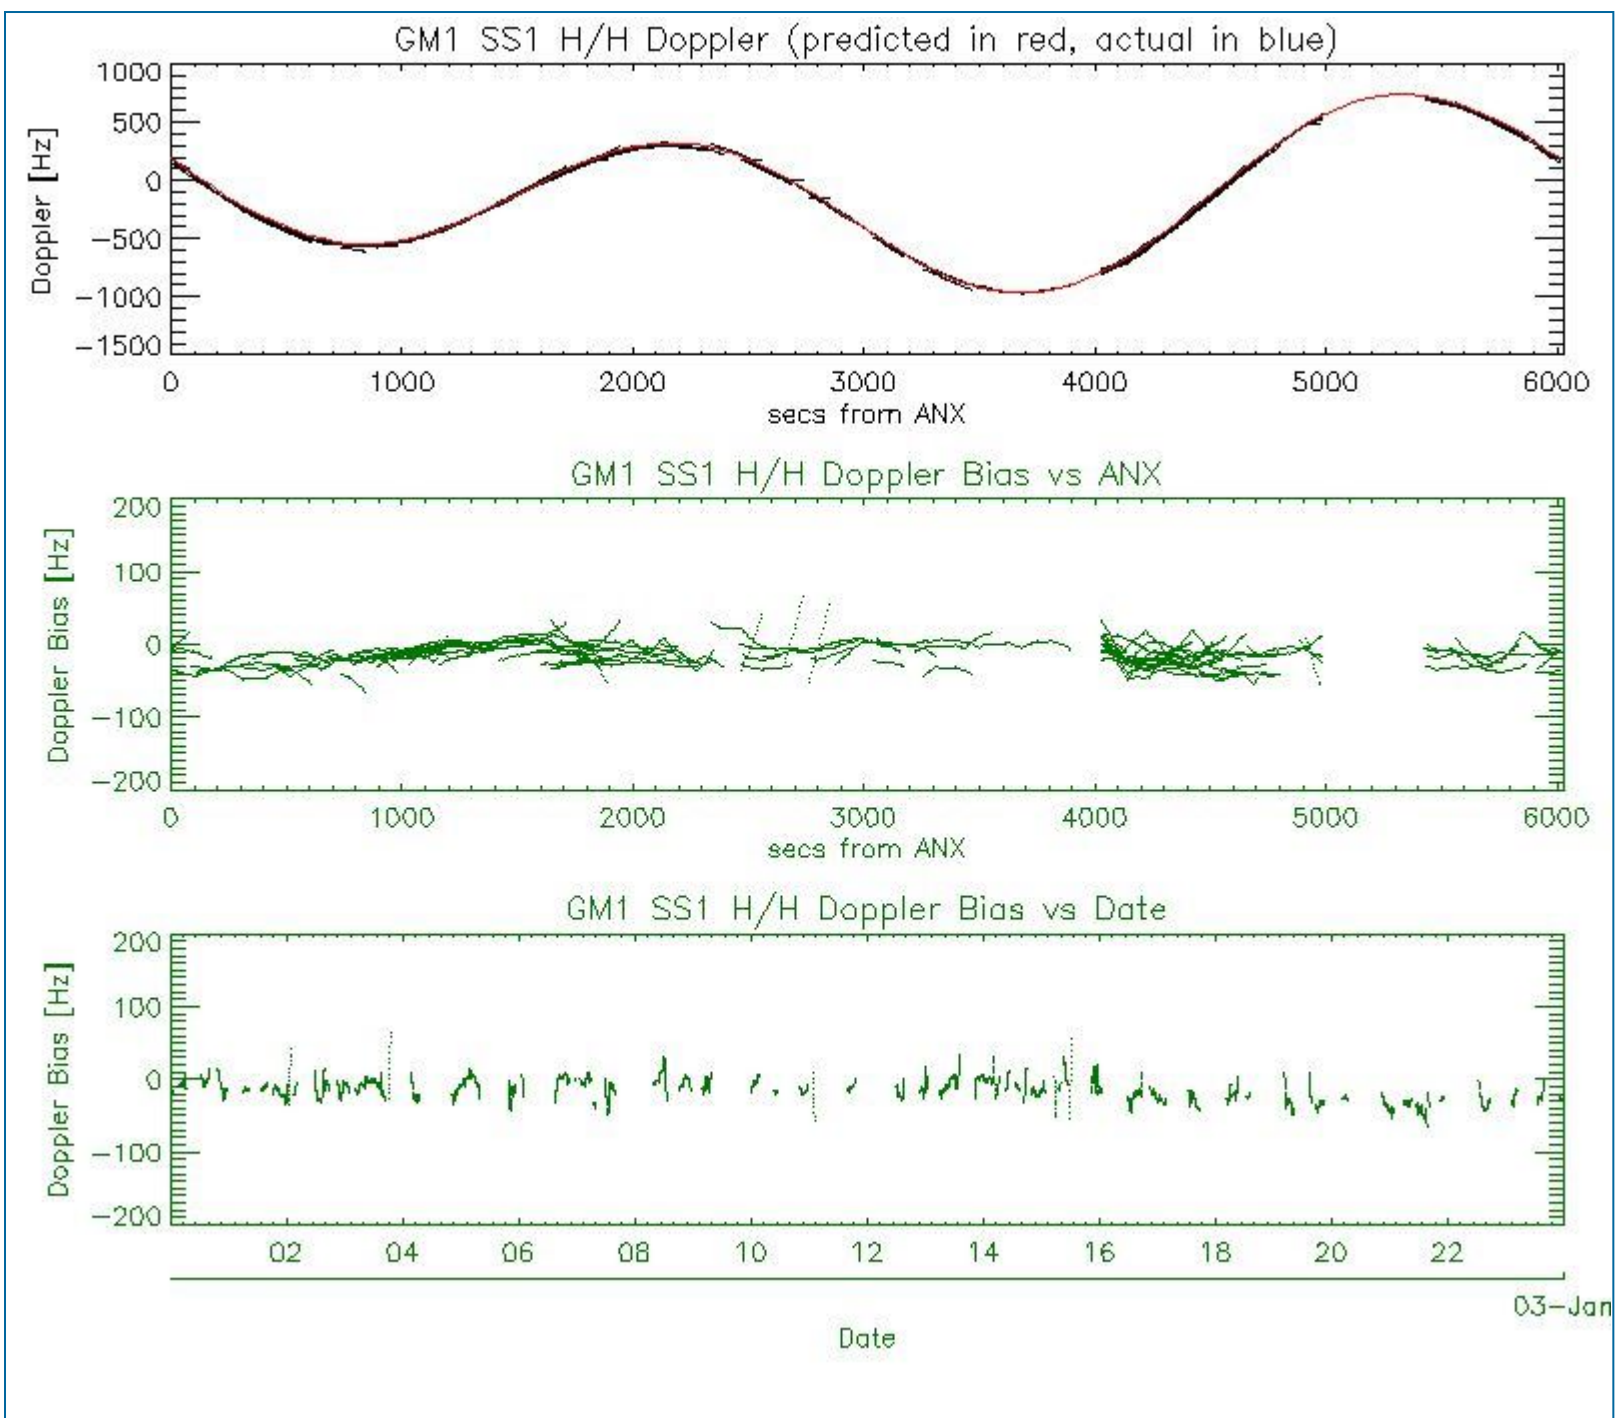

5.3 - Doppler JUMPS Analysis for WSM

[BACK TO MENU]



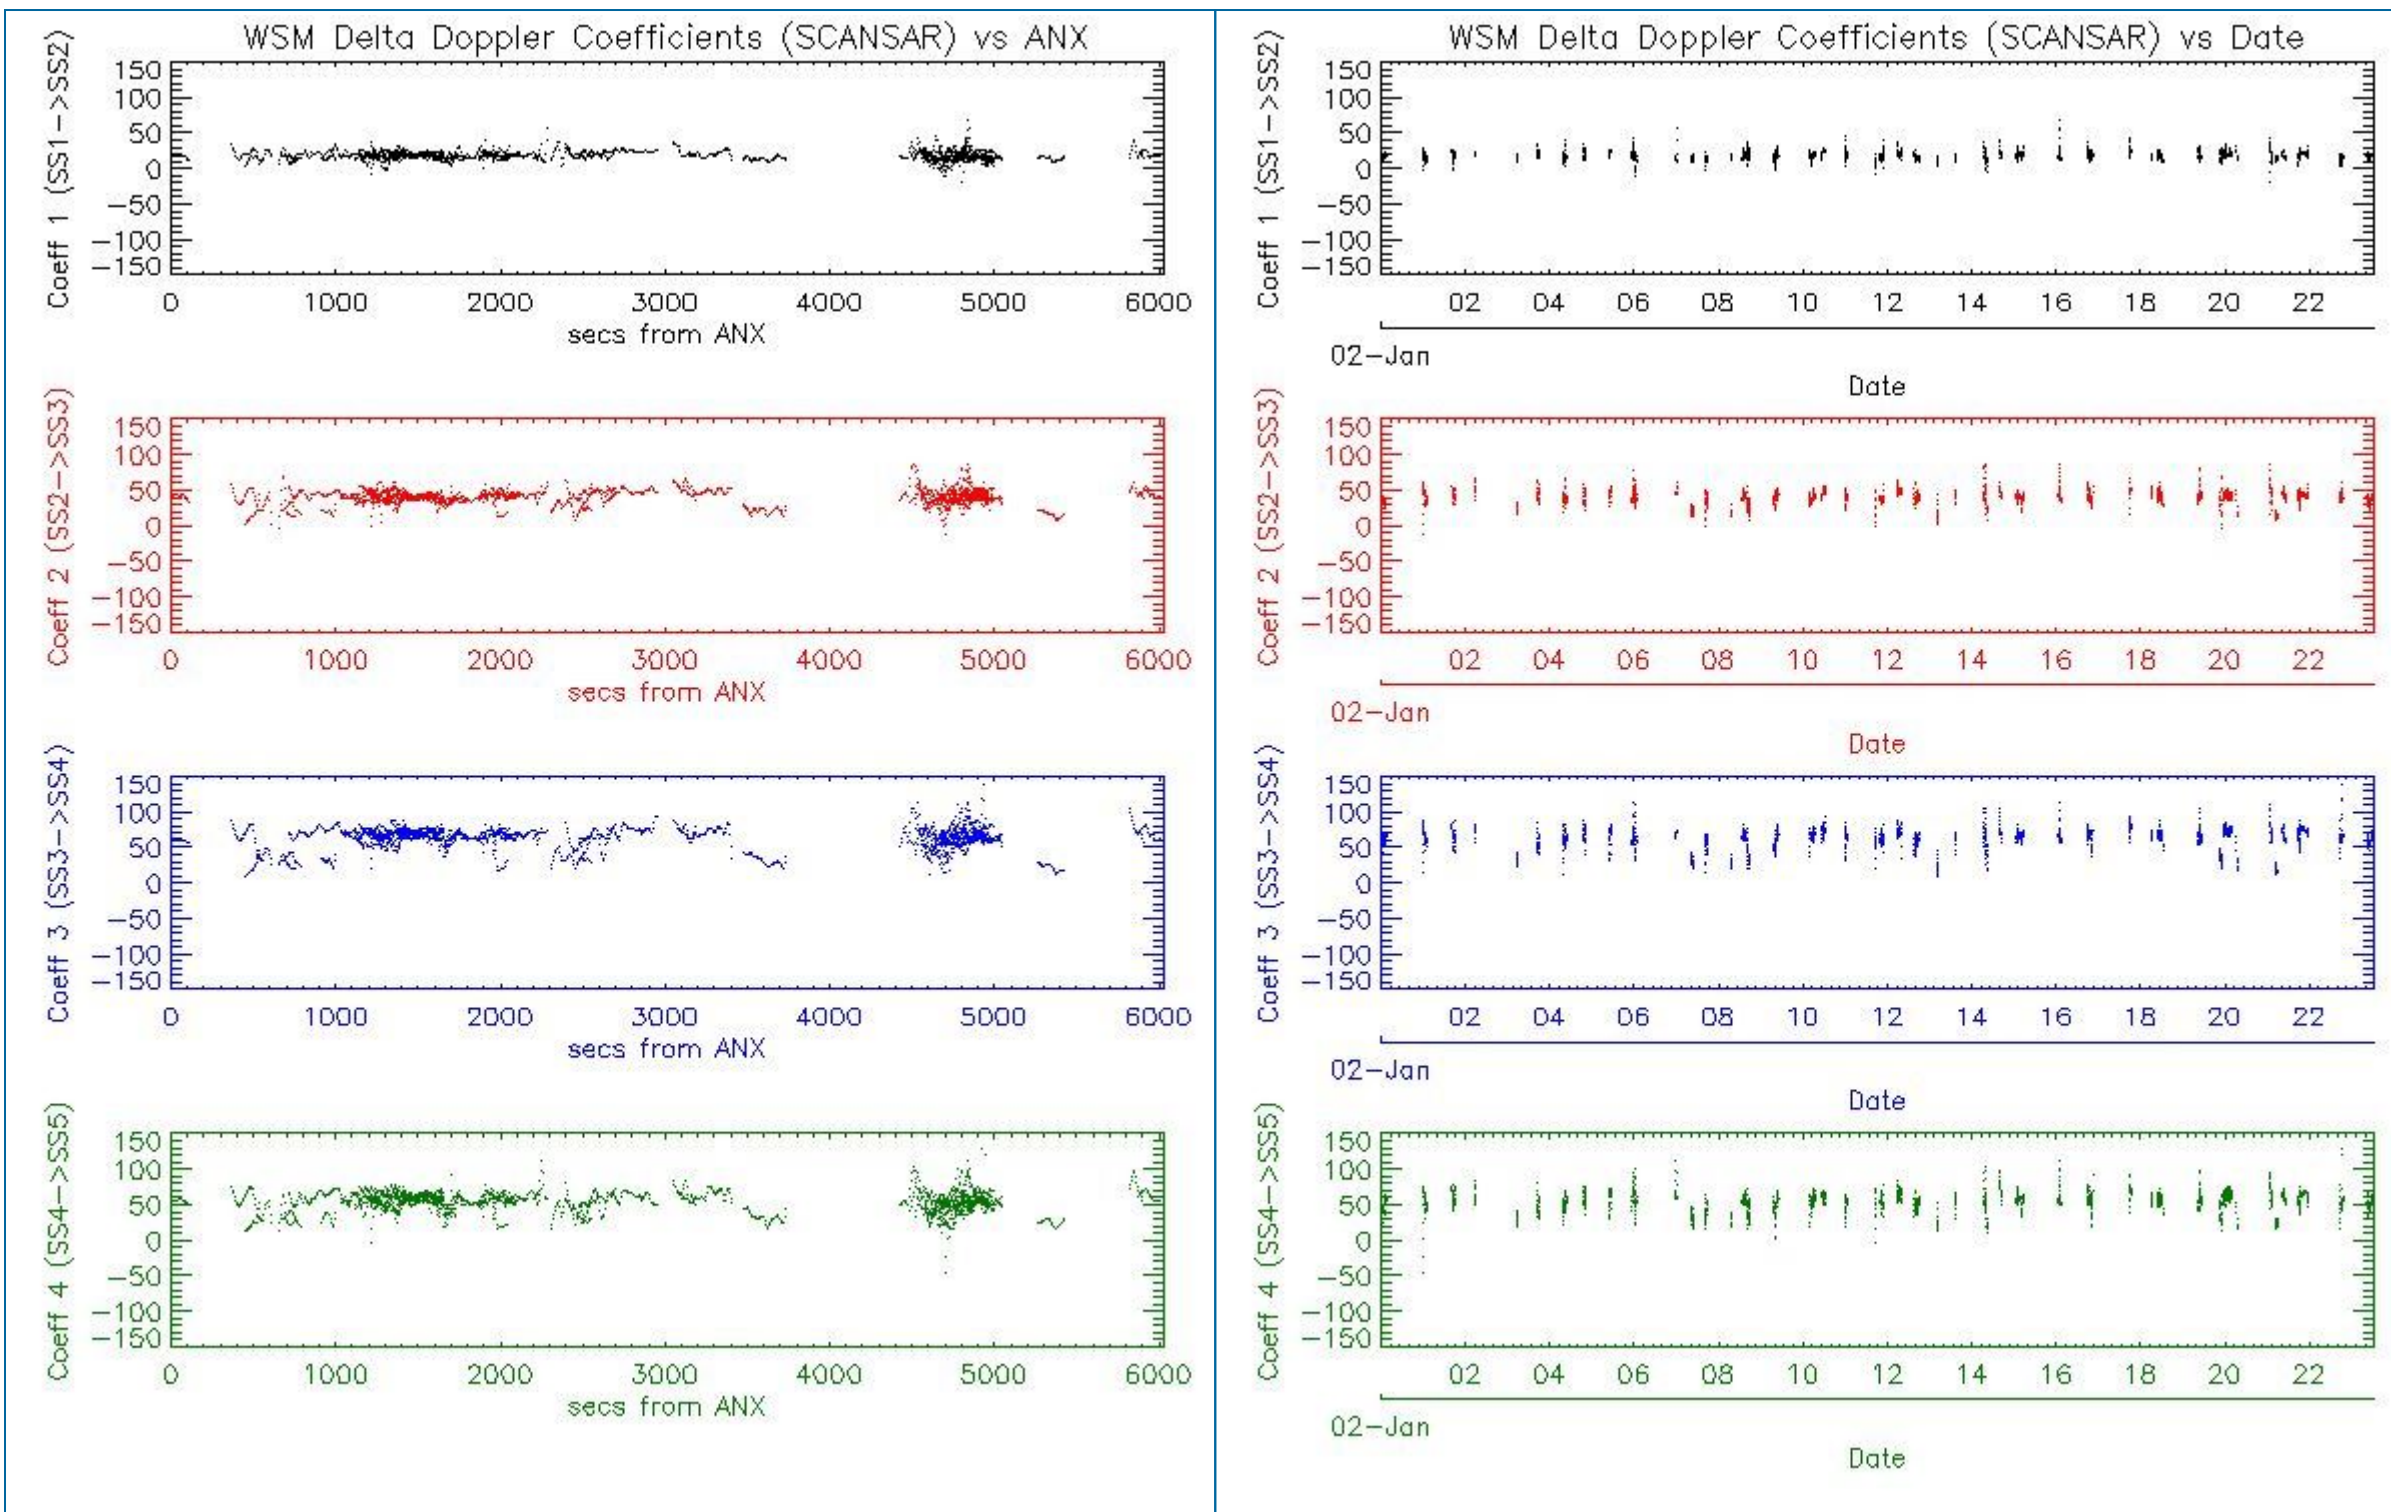



6 - CHIRP ANALYSIS

6.1 - Analysis for WSM SS1 H/H

6.1.1 - ScaleFactor

[[BACK TO MENU](#)]





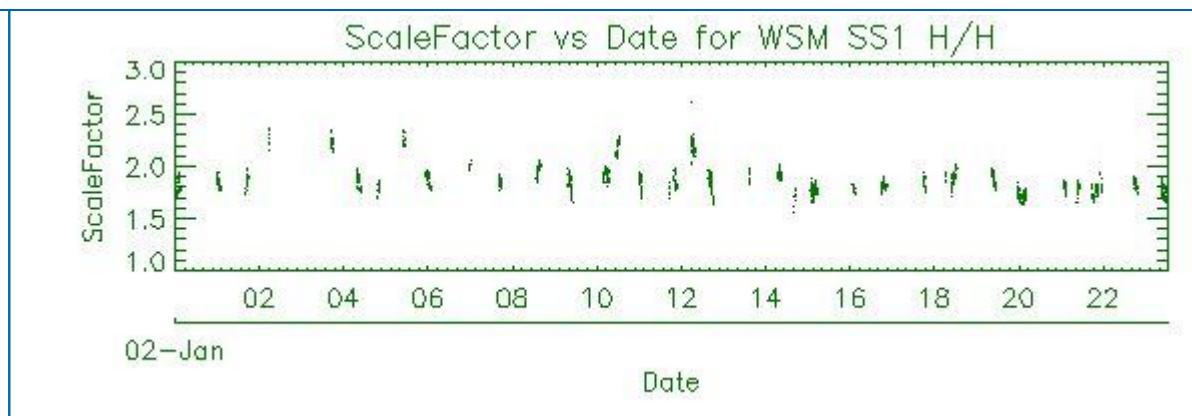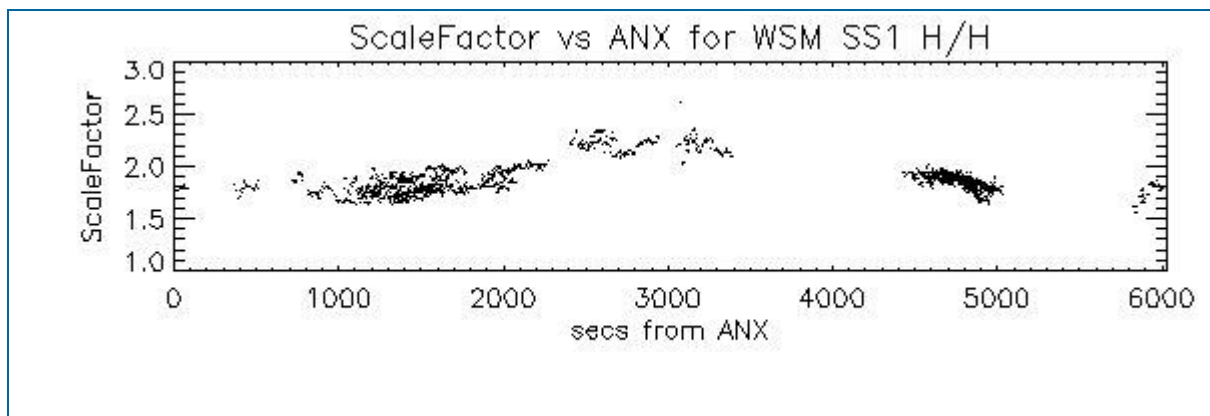

6.2 - Analysis for WSM SS1 V/V

6.2.1 - ScaleFactor

[[BACK TO MENU](#)]


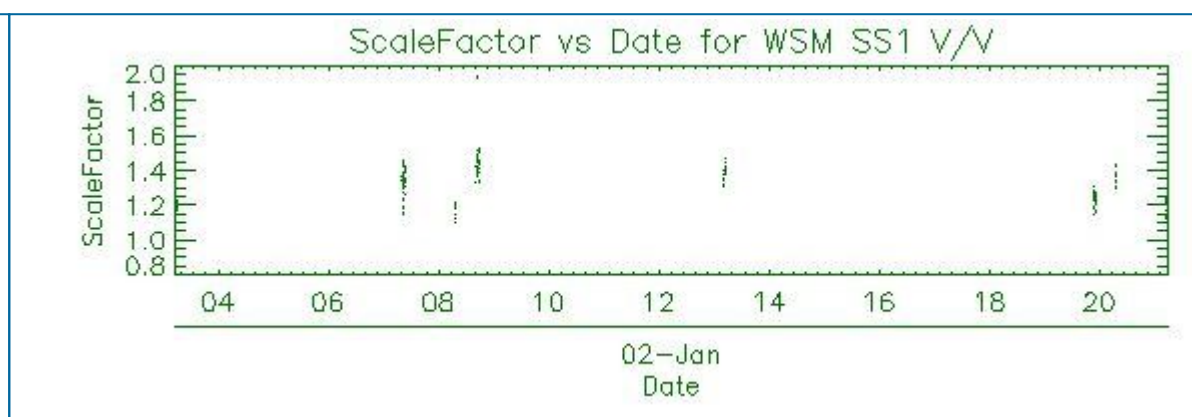
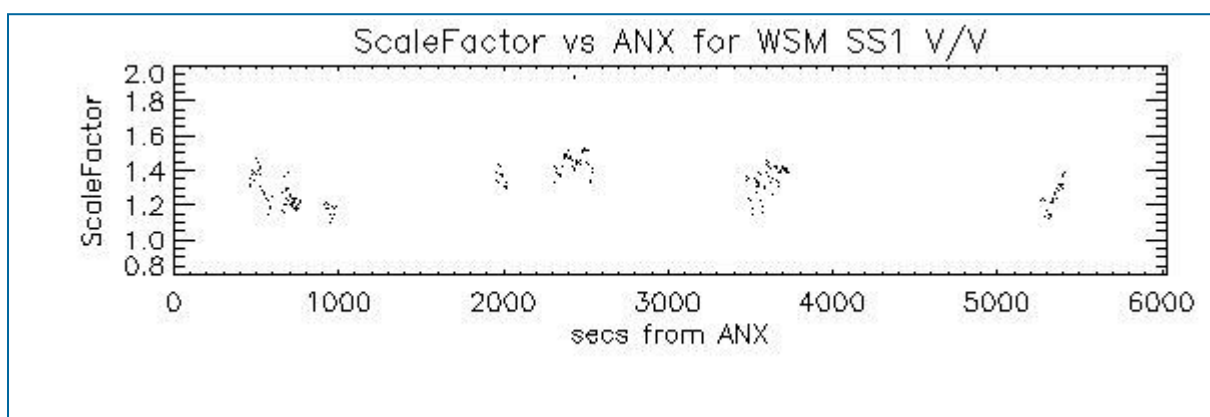


7 - RAW DATA ANALYSIS

7.1 - Analysis for WVS

[[BACK TO MENU](#)]


--	--	--

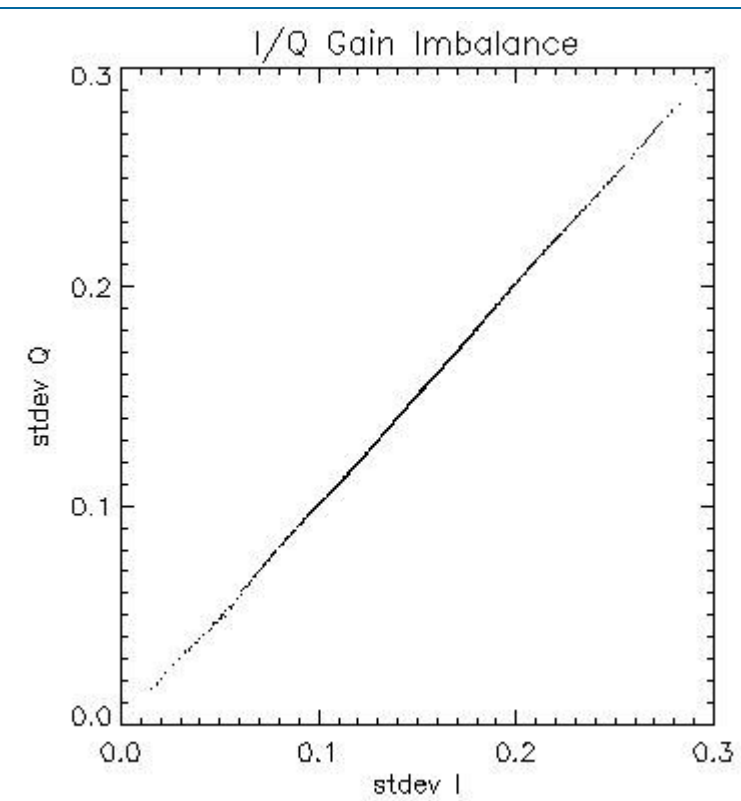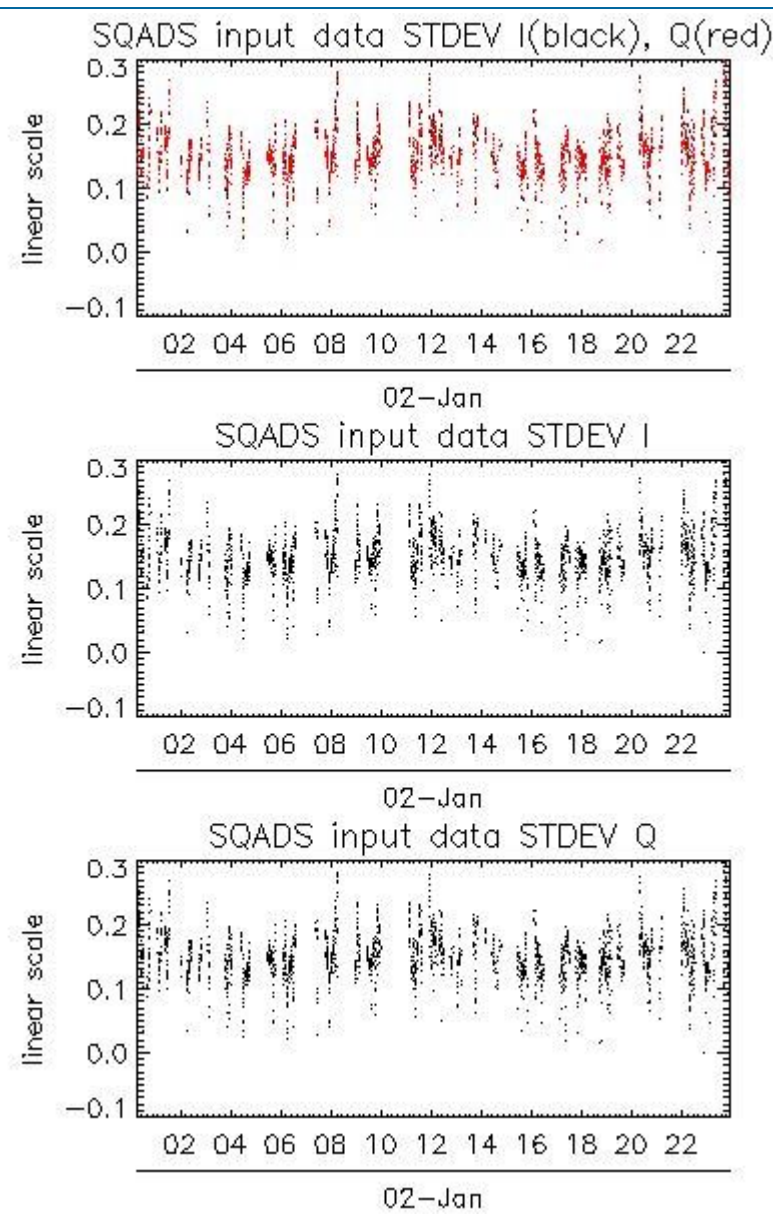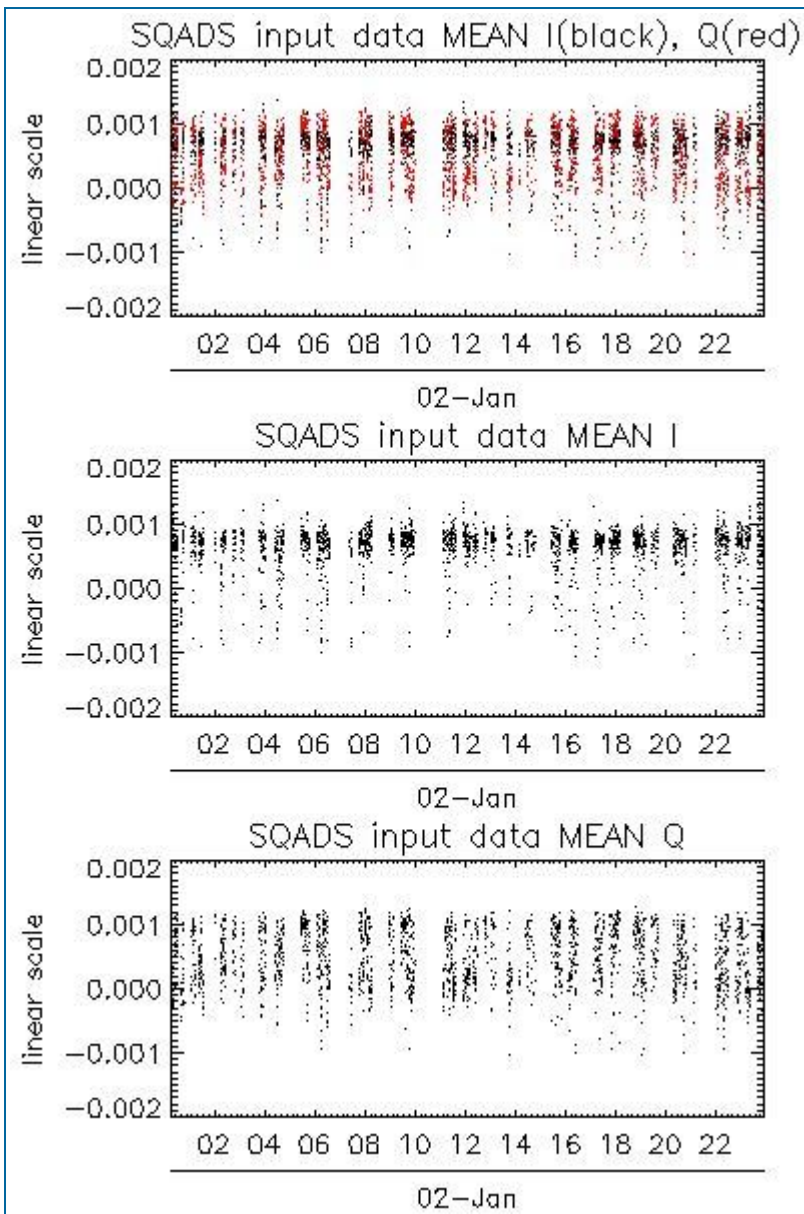


Channel	Statistics	DSS-B
MEAN I	mean	0.000632198
	stdev	1.30423e-07
MEAN Q	mean	0.000485271
	stdev	2.06011e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.151442
	stdev	0.00154346
STDEV Q	mean	0.152029
	stdev	0.00157747

7.2 - Analysis for IMM

[\[BACK TO MENU \]](#)



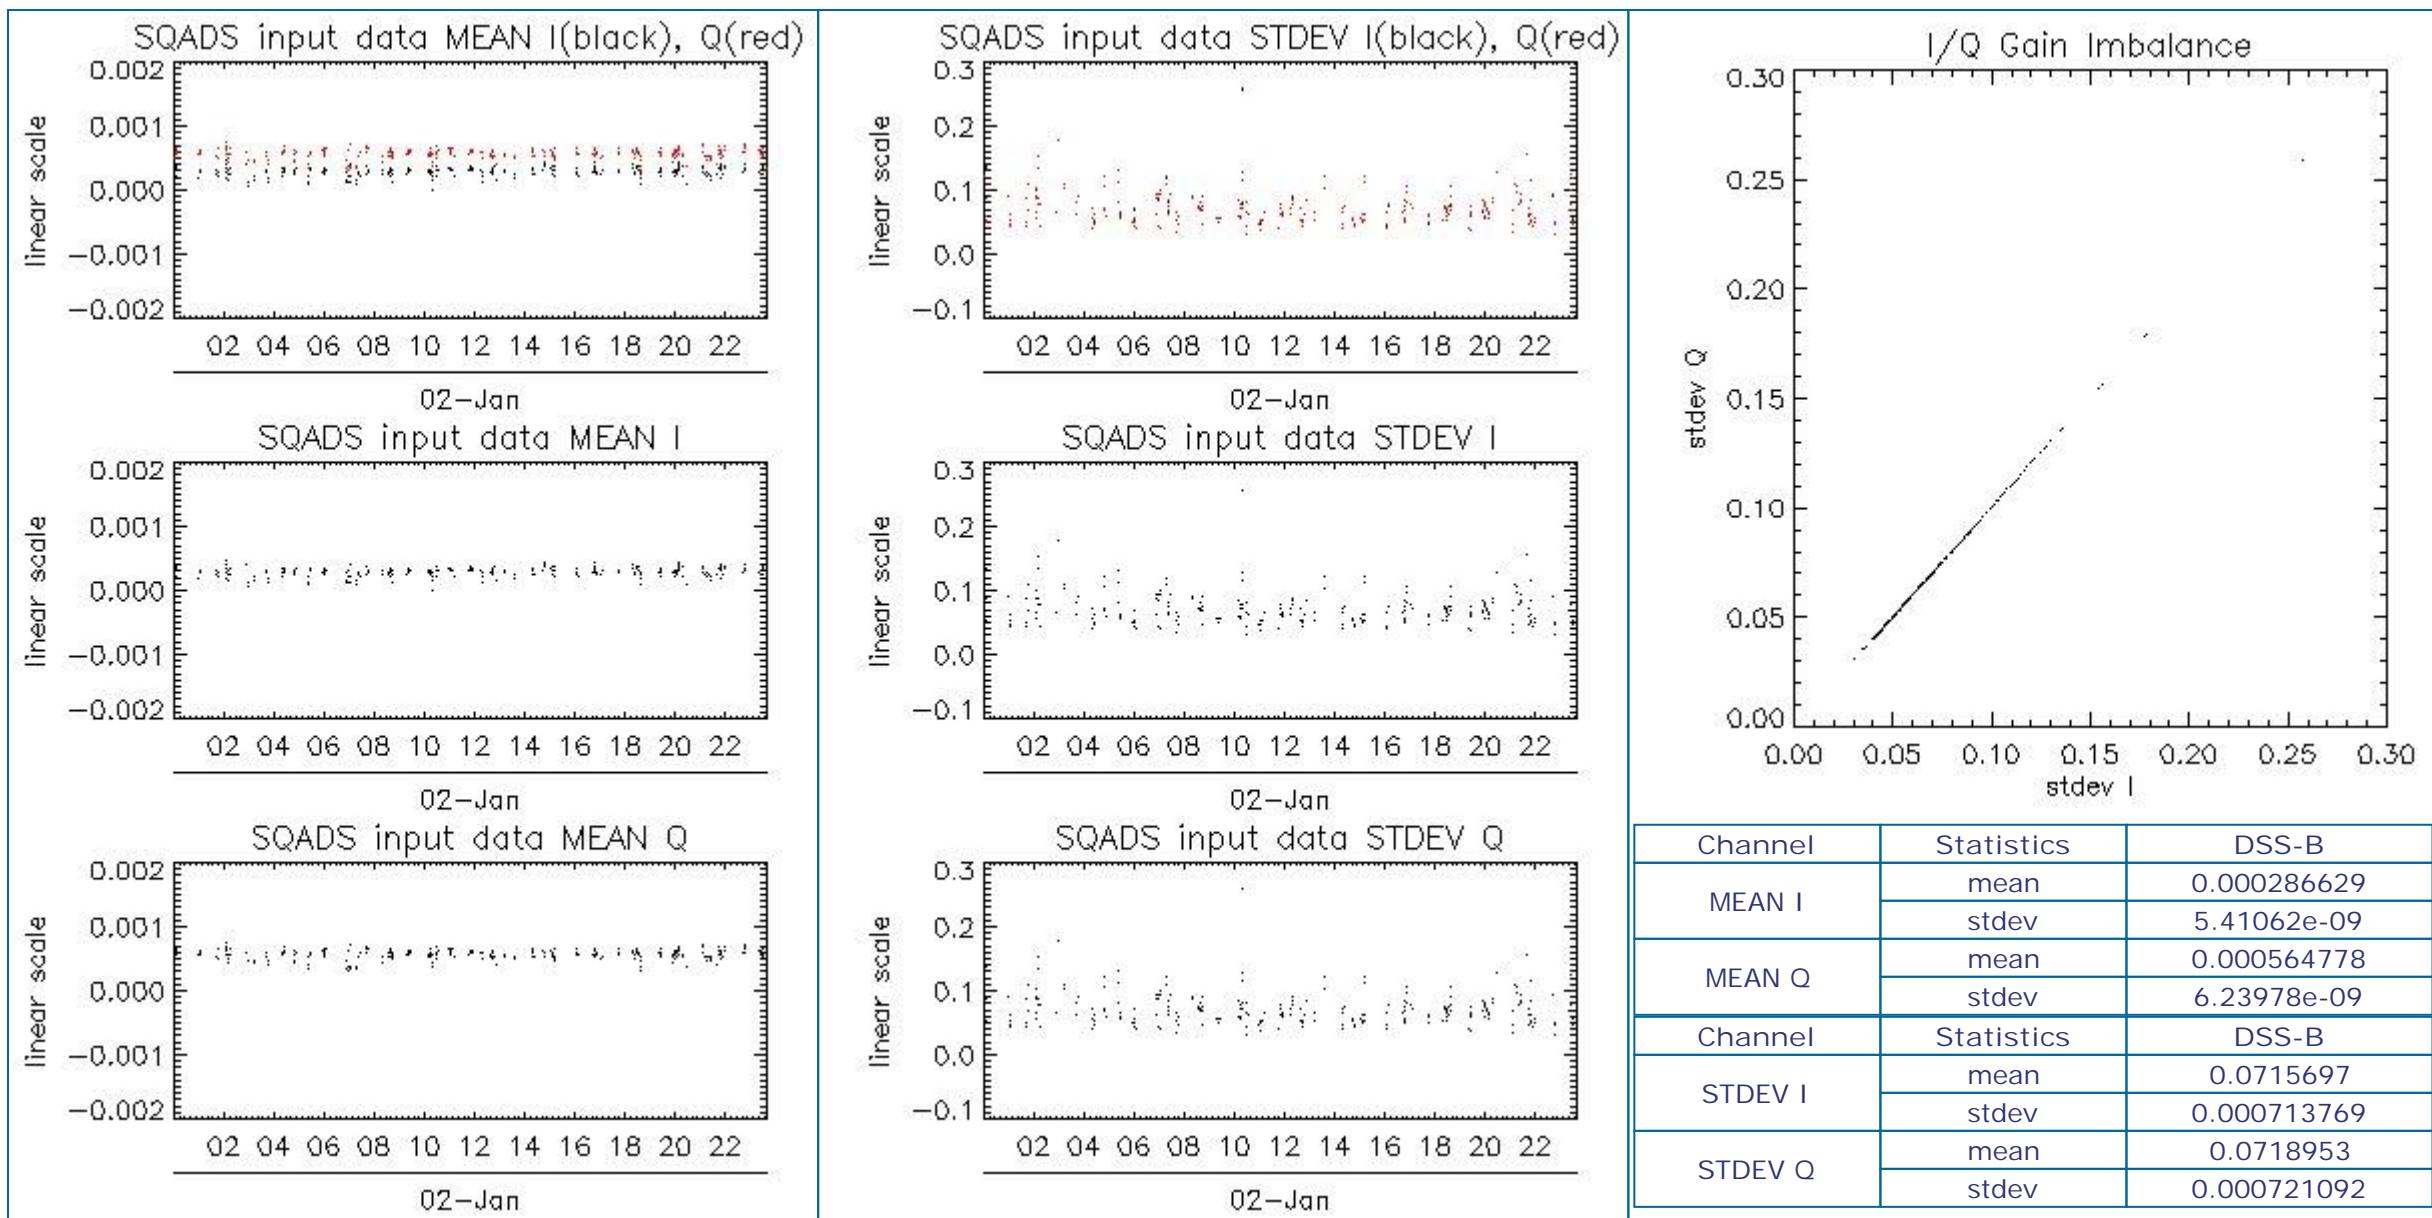



8 - TELEMETRY ANALYSIS

Processing Center	Product	Gaps	Missing lines
PDE	ASA_WVS_1PNPDE20120102_010535_000003453110_00160_51467_5583.N1	1	0
PDE	ASA_WVS_1PNPDE20120102_034740_000007643110_00162_51469_5632.N1	1	0
PDE	ASA_WVS_1PNPDE20120102_052707_000010043110_00163_51470_5673.N1	1	0
PDE	ASA_WVS_1PNPDE20120102_060516_000009743110_00163_51470_5708.N1	1	0
PDK	ASA_WVS_1PNPDK20120102_130238_000004423110_00167_51474_1339.N1	0	8

8.1 - Number of Missing lines


[BACK TO MENU]



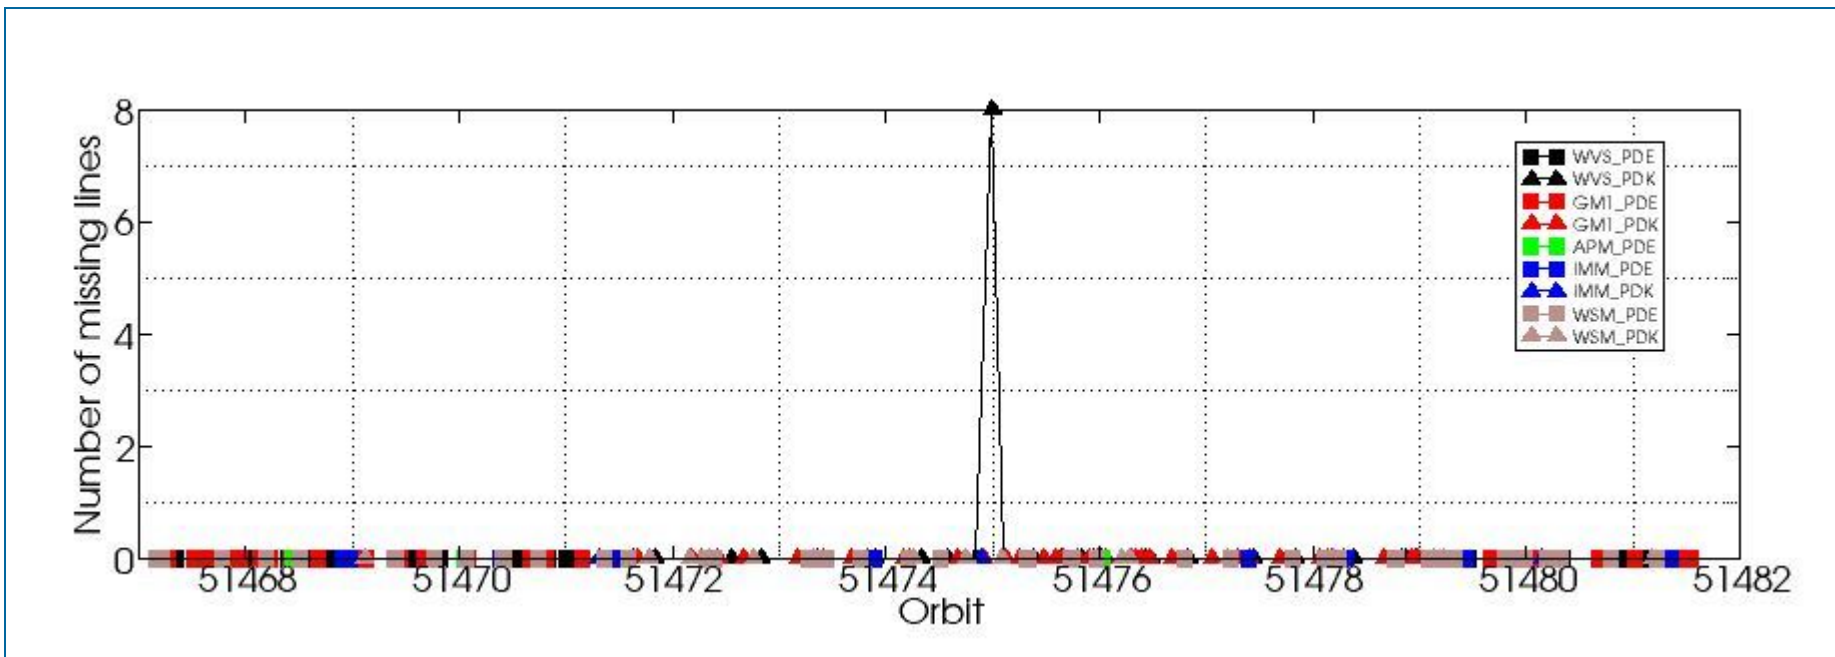

8.2 - Number of Gaps

[[BACK TO MENU](#)]

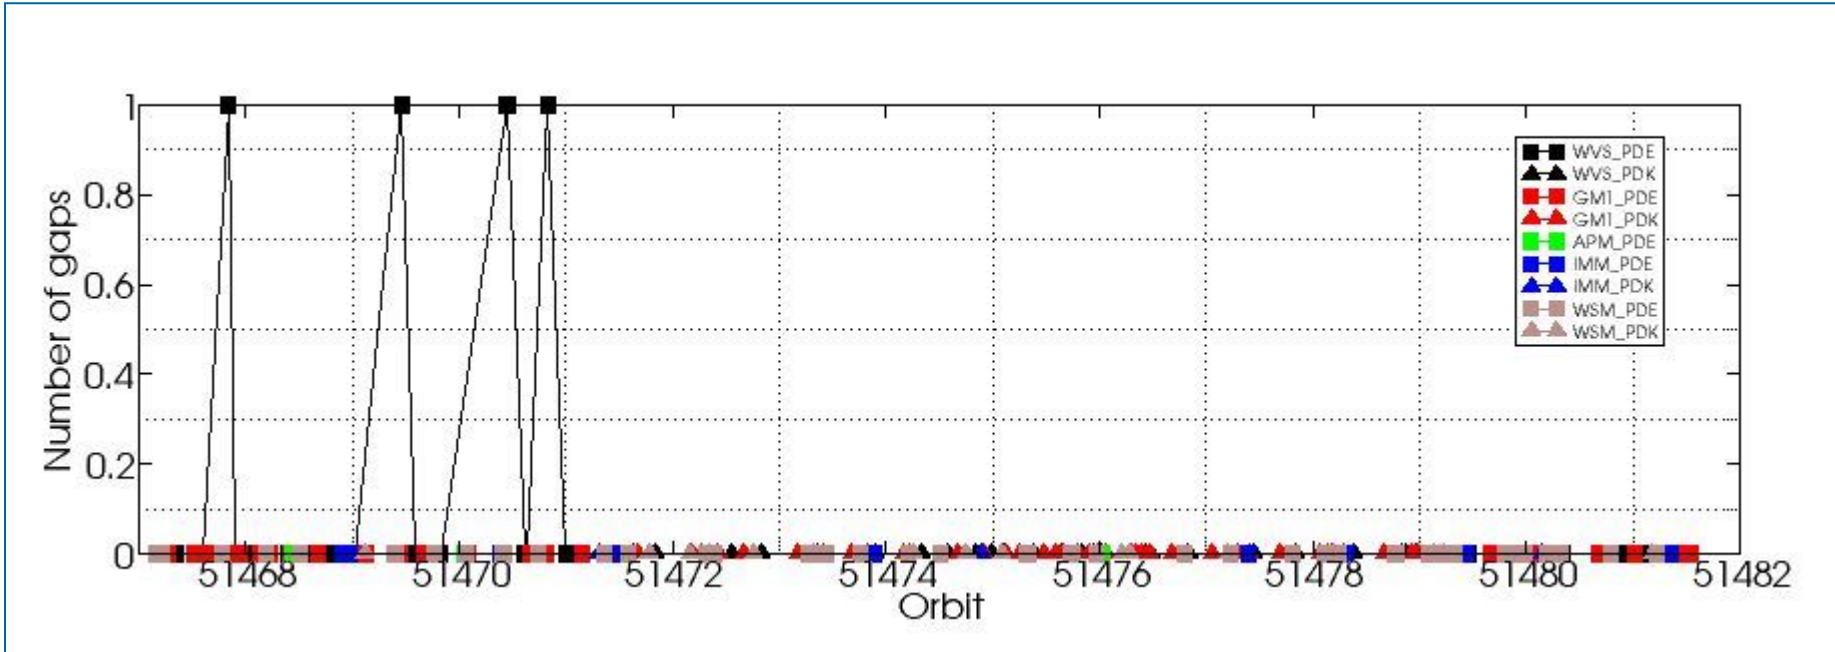

ASAR DAILY REPORT for 120102
#####

MODE: DAILY
ANALYSIS: ALL
DATE: 2012-01-02 00:00:00

Analysis will be performed from 2012-01-02 00:00:00 to 2012-01-02 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_120102/

DATA SUMMARY

Summary will be performed from 2012-01-02 00:00:00 to 2012-01-02 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_120102/DATA_SUMMARY

Creating directory ./RESULTS/DAILY/_120102/DATA_SUMMARY...
Writing file ./RESULTS/DAILY/_120102/DATA_SUMMARY/Data_summary.html...

Getting WVS products list from 2012-01-02 00:00:00 to 2012-01-02 23:59:59...
Writing file ./RESULTS/DAILY/_120102/DATA_SUMMARY/List_WVS_products_used.xls...
Writing file ./RESULTS/DAILY/_120102/DATA_SUMMARY/List_WVS_products_used.txt...

Getting GM1 products list from 2012-01-02 00:00:00 to 2012-01-02 23:59:59...
Writing file ./RESULTS/DAILY/_120102/DATA_SUMMARY/List_GM1_products_used.xls...
Writing file ./RESULTS/DAILY/_120102/DATA_SUMMARY/List_GM1_products_used.txt...

Getting APM products list from 2012-01-02 00:00:00 to 2012-01-02 23:59:59...
Writing file ./RESULTS/DAILY/_120102/DATA_SUMMARY/List_APM_products_used.xls...
Writing file ./RESULTS/DAILY/_120102/DATA_SUMMARY/List_APM_products_used.txt...

Getting IMM products list from 2012-01-02 00:00:00 to 2012-01-02 23:59:59...
Writing file ./RESULTS/DAILY/_120102/DATA_SUMMARY/List_IMM_products_used.xls...
Writing file ./RESULTS/DAILY/_120102/DATA_SUMMARY/List_IMM_products_used.txt...

Getting WSM products list from 2012-01-02 00:00:00 to 2012-01-02 23:59:59...
Writing file ./RESULTS/DAILY/_120102/DATA_SUMMARY/List_WSM_products_used.xls...
Writing file ./RESULTS/DAILY/_120102/DATA_SUMMARY/List_WSM_products_used.txt...

Getting MS products list from 2012-01-02 00:00:00 to 2012-01-02 23:59:59...
Writing file ./RESULTS/DAILY/_120102/DATA_SUMMARY/List_MS_products_used.xls...
Writing file ./RESULTS/DAILY/_120102/DATA_SUMMARY/List_MS_products_used.txt...

DATA SUMMARY completed
#####

AUXILIARY FILES ANALYSIS

Analysis will be performed from 2012-01-02 00:00:00 to 2012-01-02 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_120102/AUXILIARY

Creating directory ./RESULTS/DAILY/_120102/AUXILIARY...

Looking for the IECF operational ADFs list...



ADF filter 20120102*current_3_IECF_ADFs.txt
 Found list 20120102_030000_current_3_IECF_ADFs.txt...
 Extracting ADFs...

ASA_CON_AXVIEC20110526_075001_20101027_215740_20141231_000000
 ASA_INS_AXVIEC20110124_114858_20101228_112000_20141231_235959
 ASA_XCH_AXVIEC20101222_143057_20020301_000000_20141231_000000
 ASA_XCA_AXVIEC20110526_075734_20101027_215740_20141231_000000

Writing file ./RESULTS/DAILY/_120102/AUXILIARY/ASAR_ADFs_IECF_List3.html...
 Writing file ./RESULTS/DAILY/_120102/AUXILIARY/Auxiliary_files_summary.html...

Analysing WVS products...

Writing file ./RESULTS/DAILY/_120102/AUXILIARY/Check_ADFs_WVS.xls...
 Writing file ./RESULTS/DAILY/_120102/AUXILIARY/Check_ADFs_WVS.txt...

ASA_WVS_1PNPDE20120102_001638_000008993110_00160_51467_5578.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_004047_000004203110_00160_51467_5582.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_010535_000003453110_00160_51467_5583.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_011035_000002393110_00160_51467_5625.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_012118_000007493110_00160_51467_5610.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_020051_000000743110_00161_51468_5620.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_021444_000007953110_00161_51468_5619.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_024448_000003003110_00161_51468_5628.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_030458_000003143110_00162_51469_5623.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_034740_000007643110_00162_51469_5632.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_040009_000002403110_00162_51469_5668.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_042453_000012293110_00162_51469_5672.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_052707_000010043110_00163_51470_5673.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_054336_000000153110_00163_51470_5704.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_054626_000001203110_00163_51470_5705.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_060516_000009743110_00163_51470_5708.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_062146_000008843110_00163_51470_5713.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_201816_000005693110_00172_51479_5862.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_202922_000012743110_00172_51479_5864.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_210735_000002253110_00172_51479_5888.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_215838_000019343110_00173_51480_5891.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_224833_000002993110_00173_51480_5897.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_225233_000007643110_00173_51480_5906.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_231129_000005843110_00174_51481_5908.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120102_233955_000008843110_00174_51481_5911.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_072445_000002403110_00164_51471_1245.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_074521_000019043110_00164_51471_1247.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_085747_000006753110_00165_51472_1276.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_092535_000020093110_00165_51472_1278.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_110557_00002553110_00166_51473_1309.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_111258_000015443110_00166_51473_1313.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_115524_000010643110_00167_51474_1335.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_121952_000005703110_00167_51474_1336.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_124602_000003303110_00167_51474_1338.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_130238_000004423110_00167_51474_1339.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_131254_000000453110_00168_51475_1341.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_134138_000005243110_00168_51475_1361.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_140814_000000903110_00168_51475_1365.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_142625_000003903110_00168_51475_1367.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_143745_000001043110_00168_51475_1369.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_144454_000000893110_00169_51476_1370.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_152643_000001193110_00169_51476_1396.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_153108_000011243110_00169_51476_1401.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_160653_000012593110_00169_51476_1404.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_170837_000012893110_00170_51477_1421.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_174707_000013643110_00170_51477_1424.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_184243_000016643110_00171_51478_1454.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_192659_000001503110_00171_51478_1453.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

ASA_WVS_1PNPDK20120102_193148_000002553110_00171_51478_1455.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120102_193928_000001343110_00171_51478_1458.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing GM1 products...

Writing file ./RESULTS/DAILY/_120102/AUXILIARY/Check_ADFs_GM1.xls...

Writing file ./RESULTS/DAILY/_120102/AUXILIARY/Check_ADFs_GM1.txt...

ASA_GM1_1PNPDE20120102_000047_000001323110_00160_51467_5574.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_000746_000005313110_00160_51467_5580.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_003217_000001083110_00160_51467_5579.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_003504_000003383110_00160_51467_5577.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_004831_000006713110_00160_51467_5584.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_011514_000003623110_00160_51467_5608.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_013429_000003683110_00161_51468_5609.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_014515_000009363110_00161_51468_5612.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_020246_000000963110_00161_51468_5622.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_020752_000001753110_00161_51468_5621.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_022845_000009613110_00161_51468_5618.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_025219_000003983110_00161_51468_5617.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_030022_000002713110_00161_51468_5630.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_031058_000001143110_00162_51469_5629.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_031506_000016013110_00162_51469_5624.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_034608_000000843110_00162_51469_5633.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_040858_000005253110_00162_51469_5669.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_045102_000017583110_00163_51470_5678.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_054914_000004593110_00163_51470_5706.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_060333_000000963110_00163_51470_5709.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_063710_000009433110_00164_51471_5710.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_065737_000000723110_00164_51471_5716.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_070322_000007433110_00164_51471_5715.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_071745_000001443110_00164_51471_5714.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_201057_000003443110_00172_51479_5863.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_205119_000007733110_00172_51479_5865.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_211447_000004343110_00172_51479_5884.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_212615_000005013110_00173_51480_5886.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_213642_000001083110_00173_51480_5885.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_213922_000000843110_00173_51480_5889.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_215213_000002293110_00173_51480_5890.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_223132_000007133110_00173_51480_5893.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_230605_000003203110_00174_51481_5907.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_233208_000004163110_00174_51481_5910.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_235522_000001323110_00174_51481_5909.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120102_235900_000003083110_00174_51481_5912.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_072927_000006163110_00164_51471_1246.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_081924_000007073110_00165_51472_1248.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_082959_000002173110_00165_51472_1274.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_084518_000007493110_00165_51472_1275.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_090940_000005433110_00165_51472_1277.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_095955_000005553110_00166_51473_1279.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_102408_000001693110_00166_51473_1305.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_104954_000005433110_00166_51473_1307.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_110441_000000663110_00166_51473_1311.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_113930_000002173110_00167_51474_1310.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_114425_000002713110_00167_51474_1312.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_123011_000004833110_00167_51474_1337.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_125339_000005373110_00167_51474_1340.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_131429_000009123110_00168_51475_1342.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_132829_000004343110_00168_51475_1359.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_135114_000006893110_00168_51475_1360.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_140247_000003263110_00168_51475_1362.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_141021_000003983110_00168_51475_1363.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_142214_000002473110_00168_51475_1364.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_143342_000002413110_00168_51475_1366.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_144150_000001813110_00168_51475_1368.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

```
ASA_GM1_1PNPDK20120102_144920_000008583110_00169_51476_1372.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_151335_00000843110_00169_51476_1399.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_151736_000001503110_00169_51476_1398.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_152224_000002593110_00169_51476_1397.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_152931_00000903110_00169_51476_1400.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_155153_000006893110_00169_51476_1402.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_162842_000009063110_00170_51477_1403.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_165219_000006283110_00170_51477_1419.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_170454_000002233110_00170_51477_1420.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_173207_000007013110_00170_51477_1422.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_181040_000003083110_00171_51478_1423.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_181723_000003023110_00171_51478_1425.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_182105_000001503110_00171_51478_1451.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_183205_000001753110_00171_51478_1452.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_191105_000006223110_00171_51478_1456.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_193641_000001633110_00171_51478_1457.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120102_194229_000006223110_00171_51478_1459.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

Analysing APM products...

Writing file ./RESULTS/DAILY/_120102/AUXILIARY/Check_ADFs_APM.xls...

Writing file ./RESULTS/DAILY/_120102/AUXILIARY/Check_ADFs_APM.txt...

```
ASA_APM_1PNPDE20120102_020426_00000863110_00161_51468_5614.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20120102_020650_00000433110_00161_51468_5613.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20120102_021050_00000433110_00161_51468_5615.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20120102_021201_00000443110_00161_51468_5616.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20120102_044703_00000433110_00163_51470_5671.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20120102_144659_00000733110_00169_51476_5837.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

Analysing IMM products...

Writing file ./RESULTS/DAILY/_120102/AUXILIARY/Check_ADFs_IMM.xls...

Writing file ./RESULTS/DAILY/_120102/AUXILIARY/Check_ADFs_IMM.txt...

```
ASA_IMM_1PNPDE20120102_025133_00000383110_00161_51468_5626.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120102_025855_00000753110_00161_51468_5631.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120102_052021_000001583110_00163_51470_5665.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120102_070127_000001053110_00164_51471_5703.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120102_071543_000001153110_00164_51471_5707.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120102_101747_00000393110_00166_51473_5767.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120102_111118_00000523110_00166_51473_5788.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120102_170320_00000823110_00170_51477_5845.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120102_183501_000002033110_00171_51478_5855.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120102_202831_00000433110_00172_51479_5876.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120102_233901_00000443110_00174_51481_5924.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20120102_065250_000002763110_00164_51471_1228.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20120102_101828_00000753110_00166_51473_1290.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20120102_125252_00000373110_00167_51474_1351.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20120102_213833_00000373110_00173_51480_1481.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

Analysing WSM products...

Writing file ./RESULTS/DAILY/_120102/AUXILIARY/Check_ADFs_WSM.xls...

Writing file ./RESULTS/DAILY/_120102/AUXILIARY/Check_ADFs_WSM.txt...

```
ASA_WSM_1PNPDE20120102_000308_000002753110_00160_51467_5590.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_005942_000003553110_00160_51467_5576.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_014039_000002693110_00161_51468_5611.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

ASA_WSM_1PNPDE20120102_021314_00000923110_00161_51468_5627.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_034152_000002513110_00162_51469_5606.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_041749_000003923110_00162_51469_5667.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_044811_000001653110_00163_51470_5670.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_052327_000002203110_00163_51470_5666.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_055654_000003923110_00163_51470_5722.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_065901_00000923110_00164_51471_5702.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_072014_000002693110_00164_51471_5711.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_083342_000002753110_00165_51472_5745.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_084058_000002513110_00165_51472_5746.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_100914_000002143110_00166_51473_5765.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_101403_000002203110_00166_51473_5766.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_102702_000003123110_00166_51473_5768.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_105904_000003303110_00166_51473_5787.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_114312_00000733110_00167_51474_5789.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_121352_000003613110_00167_51474_5798.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_133549_000001163110_00168_51475_5834.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_141704_000003063110_00168_51475_5836.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_144016_00000923110_00168_51475_5835.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_160323_000002143110_00169_51476_5833.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_164646_000003303110_00170_51477_5844.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_174352_000001903110_00170_51477_5843.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_181548_00000923110_00171_51478_5846.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_182723_000002813110_00171_51478_5847.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_192128_000003303110_00171_51478_5854.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_195257_00000923110_00172_51479_5856.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_195502_000001103110_00172_51479_5857.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_200653_000002393110_00172_51479_5875.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_201645_00000923110_00172_51479_5874.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_210414_000001903110_00172_51479_5871.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_211159_000001653110_00172_51479_5873.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_212206_000002513110_00172_51479_5877.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_214331_000005143110_00173_51480_5899.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_215608_000001533110_00173_51480_5900.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_224327_000003063110_00173_51480_5887.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120102_232708_000003003110_00174_51481_5923.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_031300_000001223110_00162_51469_1203.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_073946_000002753110_00164_51471_1255.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_081748_00000923110_00165_51472_1256.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_083629_000002143110_00165_51472_1258.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_091844_000003923110_00165_51472_1287.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_101403_000002203110_00166_51473_1288.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_114858_000003613110_00167_51474_1321.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_123820_000004533110_00167_51474_1350.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_131049_00000923110_00168_51475_1352.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_150339_000004343110_00169_51476_1383.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_151126_000001223110_00169_51476_1384.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_164353_000002083110_00170_51477_1412.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_182342_000002513110_00171_51478_1437.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_195740_000004163110_00172_51479_1467.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_200551_000002083110_00172_51479_1468.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120102_232151_000002453110_00174_51481_1489.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

AUXILIARY FILES ANALYSIS completed

#####

MODULE STEPPING ANALYSIS

#####

Analysis will be performed from 2012-01-02 00:00:00 to 2012-01-02 23:59:59

Results will be exported to the directory: ./RESULTS/DAILY/_120102/MODULE_STEPPING

Creating directory ./RESULTS/DAILY/_120102/MODULE_STEPPING...

Creating directory ./RESULTS/DAILY/_120102/MODULE_STEPPING/FIRST_REFERENCE...

Creating directory ./RESULTS/DAILY/_120102/MODULE_STEPPING/SECOND_REFERENCE...



Creating directory ./RESULTS/DAILY/_120102/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...
Deleting old files...

Creating images comparing with second reference...

Exporting results to the directory ../../RESULTS/DAILY/_120102/MODULE_STEPPING/SECOND_REFERENCE...

Polarization: H
Reference product: ASA_MS__0PNPDK20010209_135042_0000009A024_00180_11700_0052.N1
Test product: ASA_MS__0PNPDK20120102_155035_000000163110_00169_51476_0953.N1
H
H
../../RESULTS/DAILY/_120102/MODULE_STEPPING/SECOND_REFERENCE/TGH_20120102_155035-20010209_135042.png
../../RESULTS/DAILY/_120102/MODULE_STEPPING/SECOND_REFERENCE/TPH_20120102_155035-20010209_135042.png
../../RESULTS/DAILY/_120102/MODULE_STEPPING/SECOND_REFERENCE/RGH_20120102_155035-20010209_135042.png
../../RESULTS/DAILY/_120102/MODULE_STEPPING/SECOND_REFERENCE/RPH_20120102_155035-20010209_135042.png

Polarization: V
Reference product: ASA_MS__0PNPDK20010209_140823_0000009A024_00180_11700_0054.N1
Test product: ASA_MS__0PNPDK20120102_173049_000000163110_00170_51477_0954.N1
V
V
../../RESULTS/DAILY/_120102/MODULE_STEPPING/SECOND_REFERENCE/TGV_20120102_173049-20010209_140823.png
../../RESULTS/DAILY/_120102/MODULE_STEPPING/SECOND_REFERENCE/TPV_20120102_173049-20010209_140823.png
../../RESULTS/DAILY/_120102/MODULE_STEPPING/SECOND_REFERENCE/RGV_20120102_173049-20010209_140823.png
../../RESULTS/DAILY/_120102/MODULE_STEPPING/SECOND_REFERENCE/RPV_20120102_173049-20010209_140823.png

Creating images comparing with previous product reference...

Exporting results to the directory ../../RESULTS/DAILY/_120102/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Polarization: H
Reference product: ASA_MS__0PNPDK20120101_162720_000000163110_00155_51462_0951.N1
Test product: ASA_MS__0PNPDK20120102_155035_000000163110_00169_51476_0953.N1
H
H
../../RESULTS/DAILY/_120102/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGH_20120102_155035-20120101_162720.png
../../RESULTS/DAILY/_120102/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPH_20120102_155035-20120101_162720.png
../../RESULTS/DAILY/_120102/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGH_20120102_155035-20120101_162720.png
../../RESULTS/DAILY/_120102/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPH_20120102_155035-20120101_162720.png

Polarization: V
Reference product: ASA_MS__0PNPDK20120101_180734_000000163110_00156_51463_0952.N1
Test product: ASA_MS__0PNPDK20120102_173049_000000163110_00170_51477_0954.N1
V
V
../../RESULTS/DAILY/_120102/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGV_20120102_173049-20120101_180734.png
../../RESULTS/DAILY/_120102/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPV_20120102_173049-20120101_180734.png
../../RESULTS/DAILY/_120102/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGV_20120102_173049-20120101_180734.png
../../RESULTS/DAILY/_120102/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPV_20120102_173049-20120101_180734.png

MODULE_STEPPING ANALYSIS completed
#####

CALIBRATION PULSES ANALYSIS
#####
Creating directory ./RESULTS/DAILY/_120102/CALIBRATION_PULSES...

ALL ROWS Analysis will be performed from 2012-01-02 00:00:00 to 2012-01-02 23:59:59

Analysing products WVS IS2 V/V

1 73089 7 73089

Writing image ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Calibration_pulses_all_rows_WVS_IS2_VV.png...

Analysing products GM1 SS3 H/H

1 42497 7 42497

Writing image ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Calibration_pulses_all_rows_GM1_SS3_HH.png...

TEMPORAL EVOLUTION Analysis will be performed from 2012-01-02 00:00:00 to 2012-01-02 23:59:59

Analysing products WVS IS2 V/V

Getting calibration pulses data for WVS IS2 V/V from 2012-01-02 00:00:00 to 2012-01-02 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/_120102/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2012-01-02_1.dat...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_1.png...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2012-01-02 00:00:00 to 2012-01-02 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/_120102/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2012-01-02_2.dat...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_2.png...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2012-01-02 00:00:00 to 2012-01-02 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/_120102/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2012-01-02_3.dat...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_3.png...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2012-01-02 00:00:00 to 2012-01-02 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/_120102/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2012-01-02_4.dat...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_4.png...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_4.png...

Analysing products GM1 SS3 H/H

Getting calibration pulses data for GM1 SS3 H/H from 2012-01-02 00:00:00 to 2012-01-02 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/_120102/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2012-01-02_1.dat...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_1.png...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_1.png...

Getting calibration pulses data for GM1 SS3 H/H from 2012-01-02 00:00:00 to 2012-01-02 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/_120102/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2012-01-02_2.dat...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_2.png...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2012-01-02 00:00:00 to 2012-01-02 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/_120102/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2012-01-02_3.dat...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_3.png...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2012-01-02 00:00:00 to 2012-01-02 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/_120102/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2012-01-02_4.dat...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_4.png...

Writing ../../RESULTS/DAILY/_120102//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_4.png...

CALIBRATION PULSES ANALYSIS completed

#####

DOPPLER ANALYSIS

#####

Creating directory ./RESULTS/DAILY/_120102/DOPPLER...

DOPPLER ANX Analysis will be performed from 2012-01-02 00:00:00 to 2012-01-02 23:59:59

Analysing products WVS IS2 V/V

Getting doppler data for WVS IS2 V/V from 2012-01-02 00:00:00 to 2012-01-02 23:59:59...

Writing file ./RESULTS/DAILY/_120102/DOPPLER/Doppler_data_WVS_IS2_VV_2012-01-02.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/_120102/DOPPLER/DOPPLER_ANX_WVS_IS2_VV.png...

Analysing products GM1 SS1 H/H

Getting doppler data for GM1 SS1 H/H from 2012-01-02 00:00:00 to 2012-01-02 23:59:59...

Writing file ./RESULTS/DAILY/_120102/DOPPLER/Doppler_data_GM1_SS1_HH_2012-01-02.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/_120102/DOPPLER/DOPPLER_ANX_GM1_SS1_HH.png...

DOPPLER JUMPS Analysis will be performed on WSM products from 2012-01-02 00:00:00 to 2012-01-02 23:59:59

Analysing by default products WSM

Getting doppler jumps data for WSM from 2012-01-02 00:00:00 to 2012-01-02 23:59:59...

Writing file ./RESULTS/DAILY/_120102/DOPPLER/Doppler_Jumps_data_WSM_2012-01-02.dat...

Running IDL program...

Writing file ../../RESULTS/DAILY/_120102/DOPPLER/DOPPLER_JUMPS_ANX_WSM.png...

Writing file ../../RESULTS/DAILY/_120102/DOPPLER/DOPPLER_JUMPS_Date_WSM.png...

DOPPLER MAP Analysis will be performed from 2012-01-02 00:00:00 to 2012-01-02 23:59:59

Analysing products WVS IS2 V/V

1115

Loading predicted doppler values....

./PREDICTED_DOPPLER/doppler.WV_2

Phase: descending

Found data...

Computing mean error doppler estimated-predicted...

Mean error = -37.023205 Hz

Writing file ../../RESULTS/DAILY/_120102//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_desc.jpg...

Writing file ../../RESULTS/DAILY/_120102//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_desc.jpg...

1171

Loading predicted doppler values....

./PREDICTED_DOPPLER/doppler.WV_2

Phase: ascending

Found data...

Computing mean error doppler estimated-predicted...

Mean error = -33.425246 Hz

Writing file ../../RESULTS/DAILY/_120102//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_asc.jpg...

Writing file ../../RESULTS/DAILY/_120102//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_asc.jpg...

Analysing products GM1 SS1 H/H

2880

Loading predicted doppler values....
./PREDICTED_DOPPLER/doppler.GM_1
Phase: descending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -12.361435 Hz
Writing file ../../RESULTS/DAILY/_120102//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_desc.jpg...
Writing file ../../RESULTS/DAILY/_120102//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_desc.jpg...

2429

Loading predicted doppler values....
./PREDICTED_DOPPLER/doppler.GM_1
Phase: ascending
Found data...
Computing mean error doppler estimated-predicted...
Mean error = -17.119458 Hz
Writing file ../../RESULTS/DAILY/_120102//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_asc.jpg...
Writing file ../../RESULTS/DAILY/_120102//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_asc.jpg...

DOPPLER ANALYSIS completed

#####

CHIRP ANALYSIS

#####

Creating directory ./RESULTS/DAILY/_120102/CHIRP...

CHIRP Analysis will be performed from 2012-01-02 00:00:00 to 2012-01-02 23:59:59

Analysing products WSM SS1 H/H

Getting ScaleFactor data for WSM SS1 H/H from 2012-01-02 00:00:00 to 2012-01-02 23:59:59...
Writing file ./RESULTS/DAILY/_120102/CHIRP/ScaleFactor_data_WSM_SS1_HH_2012-01-02.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/_120102/CHIRP/ScaleFactor_ANX_WSM_SS1_HH.png...
Writing file ../../RESULTS/DAILY/_120102/CHIRP/ScaleFactor_DATE_WSM_SS1_HH.png...

Analysing products WSM SS1 V/V

Getting ScaleFactor data for WSM SS1 V/V from 2012-01-02 00:00:00 to 2012-01-02 23:59:59...
Writing file ./RESULTS/DAILY/_120102/CHIRP/ScaleFactor_data_WSM_SS1_VV_2012-01-02.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/_120102/CHIRP/ScaleFactor_ANX_WSM_SS1_VV.png...
Writing file ../../RESULTS/DAILY/_120102/CHIRP/ScaleFactor_DATE_WSM_SS1_VV.png...

CHIRP ANALYSIS completed

#####

RAW DATA ANALYSIS

#####

Analysis will be performed from 2012-01-02 00:00:00 to 2012-01-02 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_120102/RAW_DATA

Creating directory ./RESULTS/DAILY/_120102/RAW_DATA...

Getting raw data for WVS from 2012-01-02 00:00:00 to 2012-01-02 23:59:59...
Writing file ./RESULTS/DAILY/_120102/RAW_DATA/Raw_data_WVS_2012-01-02.dat...
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/_120102/RAW_DATA/Raw_data_WVS_input_mean.png...
Creating image ../../RESULTS/DAILY/_120102/RAW_DATA/Raw_data_WVS_input_stdev.png...
Creating image ../../RESULTS/DAILY/_120102/RAW_DATA/Raw_data_WVS_gain_imbalance.png...

Getting raw data for IMM from 2012-01-02 00:00:00 to 2012-01-02 23:59:59...
Writing file ./RESULTS/DAILY/_120102/RAW_DATA/Raw_data_IMM_2012-01-02.dat...
Running IDL program to create graphs...

Creating image ../../RESULTS/DAILY/_120102/RAW_DATA/Raw_data_IMM_input_mean.png...
Creating image ../../RESULTS/DAILY/_120102/RAW_DATA/Raw_data_IMM_input_stdev.png...
Creating image ../../RESULTS/DAILY/_120102/RAW_DATA/Raw_data_IMM_gain_imbalance.png...

RAW DATA ANALYSIS completed
#####

TELEMETRY ANALYSIS

Analysis will be performed from 2012-01-02 00:00:00 to 2012-01-02 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_120102/TELEMETRY

Creating directory ./RESULTS/DAILY/_120102/TELEMETRY...

Looking for gaps and missing lines in WVS products...

Checking 25 products from PDE...
Found product...ASA_WVS_1PNPDE20120102_010535_000003453110_00160_51467_5583.N1 / 1 gaps / 0 missing lines
Found product...ASA_WVS_1PNPDE20120102_034740_000007643110_00162_51469_5632.N1 / 1 gaps / 0 missing lines
Found product...ASA_WVS_1PNPDE20120102_052707_000010043110_00163_51470_5673.N1 / 1 gaps / 0 missing lines
Found product...ASA_WVS_1PNPDE20120102_060516_000009743110_00163_51470_5708.N1 / 1 gaps / 0 missing lines
Checking 25 products from PDK...
Found product...ASA_WVS_1PNPDK20120102_130238_000004423110_00167_51474_1339.N1 / 0 gaps / 8 missing lines

Looking for gaps and missing lines in GM1 products...

Checking 36 products from PDE...
Checking 38 products from PDK...

Looking for gaps and missing lines in APM products...

Checking 6 products from PDE...
No products from PDK...

Looking for gaps and missing lines in IMM products...

Checking 11 products from PDE...
Checking 4 products from PDK...

Looking for gaps and missing lines in WSM products...

Checking 40 products from PDE...
Checking 16 products from PDK...

Creating graph of missing lines and gaps...

Creating image: ./RESULTS/DAILY/_120102/TELEMETRY/TELEMETRY_Missing_lines.png...
Creating image: ./RESULTS/DAILY/_120102/TELEMETRY/TELEMETRY_Gaps.png...

TELEMETRY ANALYSIS completed
#####

HTML REPORT generation
#####

Building file ./RESULTS/DAILY/_120102/asarReport.html...
Building DATA SUMMARY section...
Building AUXILIARY FILES ANALYSIS section...
Building MODULE STEPPING ANALYSIS section...
Building CALIBRATION PULSES ANALYSIS section...
Building DOPPLER ANALYSIS section...
Building CHIRP ANALYSIS section...
Building RAW DATA ANALYSIS section...
Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed
#####



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20120102_020426_000000863110_00161_51468_5614.N1		OK	OK	OK
ASA_APM_1PNPDE20120102_020650_000000433110_00161_51468_5613.N1		OK	OK	OK
ASA_APM_1PNPDE20120102_021050_000000433110_00161_51468_5615.N1		OK	OK	OK
ASA_APM_1PNPDE20120102_021201_000000443110_00161_51468_5616.N1		OK	OK	OK
ASA_APM_1PNPDE20120102_044703_000000433110_00163_51470_5671.N1		OK	OK	OK
ASA_APM_1PNPDE20120102_144659_000000733110_00169_51476_5837.N1		OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20120102_000047_000001323110_00160_51467_5574.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_000746_000005313110_00160_51467_5580.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_003217_000001083110_00160_51467_5579.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_003504_000003383110_00160_51467_5577.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_004831_000006713110_00160_51467_5584.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_011514_000003623110_00160_51467_5608.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_013429_000003683110_00161_51468_5609.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_014515_000009363110_00161_51468_5612.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_020246_000000963110_00161_51468_5622.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_020752_000001753110_00161_51468_5621.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_022845_000009613110_00161_51468_5618.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_025219_000003983110_00161_51468_5617.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_030022_000002713110_00161_51468_5630.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_031058_000001143110_00162_51469_5629.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_031506_000016013110_00162_51469_5624.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_034608_000000843110_00162_51469_5633.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_040858_000005253110_00162_51469_5669.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_045102_000017583110_00163_51470_5678.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_054914_000004593110_00163_51470_5706.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_060333_000000963110_00163_51470_5709.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_063710_000009433110_00164_51471_5710.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_065737_000000723110_00164_51471_5716.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_070322_000007433110_00164_51471_5715.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_071745_000001443110_00164_51471_5714.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_201057_000003443110_00172_51479_5863.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_205119_000007733110_00172_51479_5865.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_211447_000004343110_00172_51479_5884.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_212615_000005013110_00173_51480_5886.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_213642_000001083110_00173_51480_5885.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_213922_000000843110_00173_51480_5889.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_215213_000002293110_00173_51480_5890.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_223132_000007133110_00173_51480_5893.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_230605_000003203110_00174_51481_5907.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_233208_000004163110_00174_51481_5910.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_235522_000001323110_00174_51481_5909.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120102_235900_000003083110_00174_51481_5912.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_072927_000006163110_00164_51471_1246.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_081924_000007073110_00165_51472_1248.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_082959_000002173110_00165_51472_1274.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_084518_000007493110_00165_51472_1275.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_090940_000005433110_00165_51472_1277.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_095955_000005553110_00166_51473_1279.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_102408_000001693110_00166_51473_1305.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_104954_000005433110_00166_51473_1307.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_110441_000000663110_00166_51473_1311.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_113930_000002173110_00167_51474_1310.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_114425_000002713110_00167_51474_1312.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_123011_000004833110_00167_51474_1337.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_125339_000005373110_00167_51474_1340.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_131429_000009123110_00168_51475_1342.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_132829_000004343110_00168_51475_1359.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_135114_000006893110_00168_51475_1360.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_140247_000003263110_00168_51475_1362.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_141021_000003983110_00168_51475_1363.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_142214_000002473110_00168_51475_1364.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_143342_000002413110_00168_51475_1366.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_144150_000001813110_00168_51475_1368.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_144920_000008583110_00169_51476_1372.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_151335_000008843110_00169_51476_1399.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_151736_000001503110_00169_51476_1398.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_152224_000002593110_00169_51476_1397.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_152931_000000903110_00169_51476_1400.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_155153_000006893110_00169_51476_1402.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_162842_000009063110_00170_51477_1403.N1					OK	OK	OK	OK

ASA_GM1_1PNPDK20120102_165219_000006283110_00170_51477_1419.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_170454_000002233110_00170_51477_1420.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_173207_000007013110_00170_51477_1422.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_181040_000003083110_00171_51478_1423.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_181723_000003023110_00171_51478_1425.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_182105_000001503110_00171_51478_1451.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_183205_000001753110_00171_51478_1452.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_191105_000006223110_00171_51478_1456.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_193641_000001633110_00171_51478_1457.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120102_194229_000006223110_00171_51478_1459.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_IMM_1PNPDE20120102_025133_000000383110_00161_51468_5626.N1		OK	OK	OK
ASA_IMM_1PNPDE20120102_025855_000000753110_00161_51468_5631.N1		OK	OK	OK
ASA_IMM_1PNPDE20120102_052021_000001583110_00163_51470_5665.N1		OK	OK	OK
ASA_IMM_1PNPDE20120102_070127_000001053110_00164_51471_5703.N1		OK	OK	OK
ASA_IMM_1PNPDE20120102_071543_000001153110_00164_51471_5707.N1		OK	OK	OK
ASA_IMM_1PNPDE20120102_101747_000000393110_00166_51473_5767.N1		OK	OK	OK
ASA_IMM_1PNPDE20120102_111118_000000523110_00166_51473_5788.N1		OK	OK	OK
ASA_IMM_1PNPDE20120102_170320_000000823110_00170_51477_5845.N1		OK	OK	OK
ASA_IMM_1PNPDE20120102_183501_000002033110_00171_51478_5855.N1		OK	OK	OK
ASA_IMM_1PNPDE20120102_202831_000000433110_00172_51479_5876.N1		OK	OK	OK
ASA_IMM_1PNPDE20120102_233901_000000443110_00174_51481_5924.N1		OK	OK	OK
ASA_IMM_1PNPDK20120102_065250_000002763110_00164_51471_1228.N1		OK	OK	OK
ASA_IMM_1PNPDK20120102_101828_000000753110_00166_51473_1290.N1		OK	OK	OK
ASA_IMM_1PNPDK20120102_125252_000000373110_00167_51474_1351.N1		OK	OK	OK
ASA_IMM_1PNPDK20120102_213833_000000373110_00173_51480_1481.N1		OK	OK	OK





Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WSM_1PNPDE20120102_000308_000002753110_00160_51467_5590.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_005942_000003553110_00160_51467_5576.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_014039_000002693110_00161_51468_5611.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_021314_000000923110_00161_51468_5627.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_034152_000002513110_00162_51469_5606.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_041749_000003923110_00162_51469_5667.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_044811_000001653110_00163_51470_5670.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_052327_000002203110_00163_51470_5666.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_055654_000003923110_00163_51470_5722.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_065901_000000923110_00164_51471_5702.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_072014_000002693110_00164_51471_5711.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_083342_000002753110_00165_51472_5745.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_084058_000002513110_00165_51472_5746.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_100914_000002143110_00166_51473_5765.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_101403_000002203110_00166_51473_5766.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_102702_000003123110_00166_51473_5768.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_105904_000003303110_00166_51473_5787.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_114312_000000733110_00167_51474_5789.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_121352_000003613110_00167_51474_5798.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_133549_000001163110_00168_51475_5834.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_141704_000003063110_00168_51475_5836.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_144016_000000923110_00168_51475_5835.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_160323_000002143110_00169_51476_5833.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_164646_000003303110_00170_51477_5844.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_174352_000001903110_00170_51477_5843.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_181548_000000923110_00171_51478_5846.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_182723_000002813110_00171_51478_5847.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_192128_000003303110_00171_51478_5854.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_195257_000000923110_00172_51479_5856.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_195502_000001103110_00172_51479_5857.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_200653_000002393110_00172_51479_5875.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_201645_000000923110_00172_51479_5874.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_210414_000001903110_00172_51479_5871.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_211159_000001653110_00172_51479_5873.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_212206_000002513110_00172_51479_5877.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_214331_000005143110_00173_51480_5899.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_215608_000001533110_00173_51480_5900.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_224327_000003063110_00173_51480_5887.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120102_232708_000003003110_00174_51481_5923.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_031300_000001223110_00162_51469_1203.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_073946_000002753110_00164_51471_1255.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_081748_000000923110_00165_51472_1256.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_083629_000002143110_00165_51472_1258.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_091844_000003923110_00165_51472_1287.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_101403_000002203110_00166_51473_1288.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_114858_000003613110_00167_51474_1321.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_123820_000004533110_00167_51474_1350.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_131049_000000923110_00168_51475_1352.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_150339_000004343110_00169_51476_1383.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_151126_000001223110_00169_51476_1384.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_164353_000002083110_00170_51477_1412.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_182342_000002513110_00171_51478_1437.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_195740_000004163110_00172_51479_1467.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_200551_000002083110_00172_51479_1468.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120102_232151_000002453110_00174_51481_1489.N1					OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.





Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20120102_001638_000008993110_00160_51467_5578.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_004047_000004203110_00160_51467_5582.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_010535_000003453110_00160_51467_5583.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_011035_000002393110_00160_51467_5625.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_012118_000007493110_00160_51467_5610.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_020051_000000743110_00161_51468_5620.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_021444_000007953110_00161_51468_5619.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_024448_000003003110_00161_51468_5628.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_030458_000003143110_00162_51469_5623.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_034740_000007643110_00162_51469_5632.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_040009_000002403110_00162_51469_5668.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_042453_000012293110_00162_51469_5672.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_052707_000010043110_00163_51470_5673.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_054336_000000153110_00163_51470_5704.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_054626_000001203110_00163_51470_5705.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_060516_000009743110_00163_51470_5708.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_062146_000008843110_00163_51470_5713.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_201816_000005693110_00172_51479_5862.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_202922_000012743110_00172_51479_5864.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_210735_000002253110_00172_51479_5888.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_215838_000019343110_00173_51480_5891.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_224833_000002993110_00173_51480_5897.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_225233_000007643110_00173_51480_5906.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_231129_000005843110_00174_51481_5908.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120102_233955_000008843110_00174_51481_5911.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_072445_000002403110_00164_51471_1245.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_074521_000019043110_00164_51471_1247.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_085747_000006753110_00165_51472_1276.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_092535_000020093110_00165_51472_1278.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_110557_000002553110_00166_51473_1309.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_111258_000015443110_00166_51473_1313.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_115524_000010643110_00167_51474_1335.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_121952_000005703110_00167_51474_1336.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_124602_000003303110_00167_51474_1338.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_130238_000004423110_00167_51474_1339.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_131254_000000453110_00168_51475_1341.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_134138_000005243110_00168_51475_1361.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_140814_000000903110_00168_51475_1365.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_142625_000003903110_00168_51475_1367.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_143745_000001043110_00168_51475_1369.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_144454_000000893110_00169_51476_1370.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_152643_000001193110_00169_51476_1396.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_153108_000011243110_00169_51476_1401.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_160653_000012593110_00169_51476_1404.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_170837_000012893110_00170_51477_1421.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_174707_000013643110_00170_51477_1424.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_184243_000016643110_00171_51478_1454.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_192659_000001503110_00171_51478_1453.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_193148_000002553110_00171_51478_1455.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120102_193928_000001343110_00171_51478_1458.N1					OK	OK	OK	OK

Calibration pulses for GM1 SS3 H/H

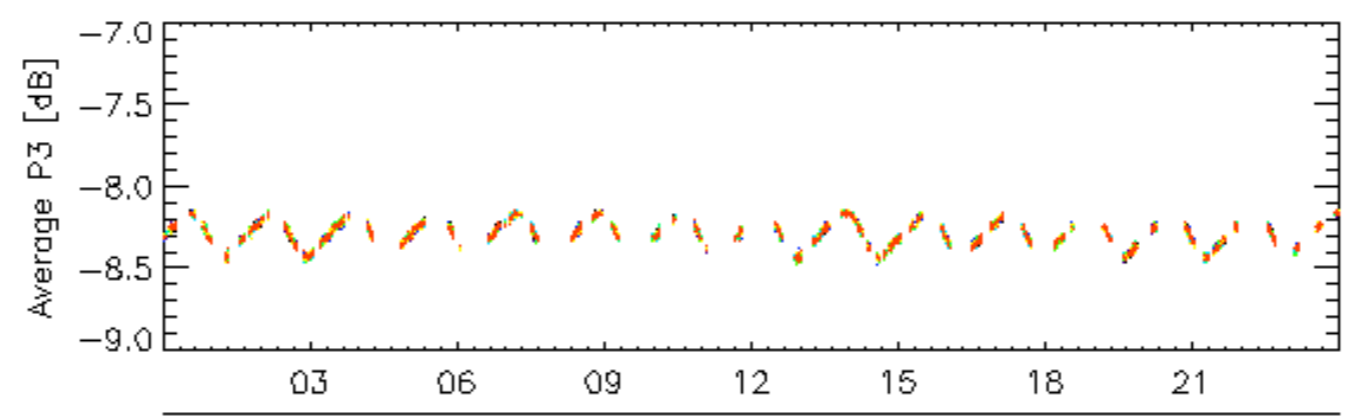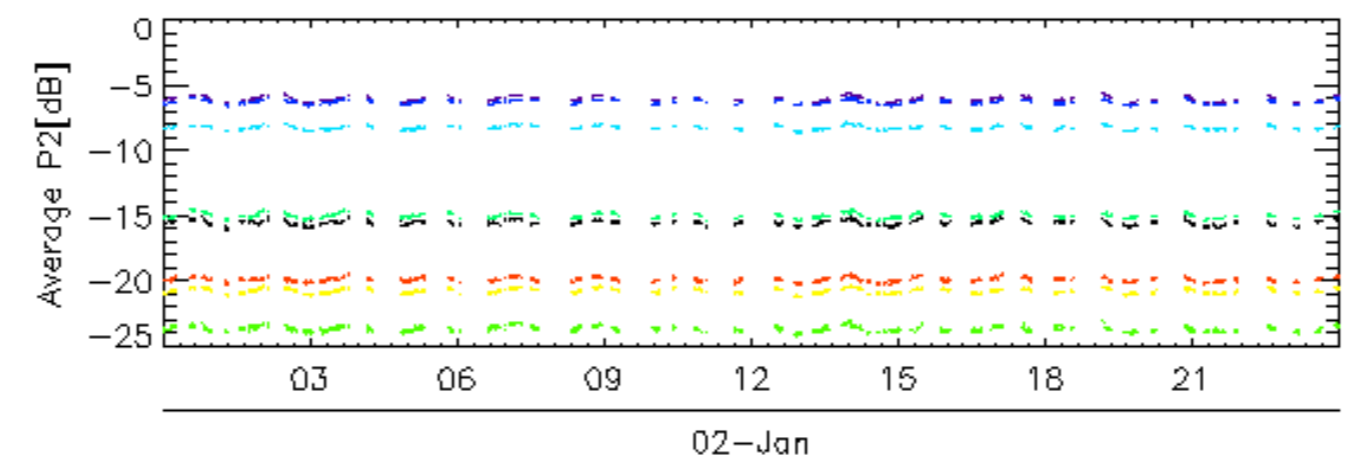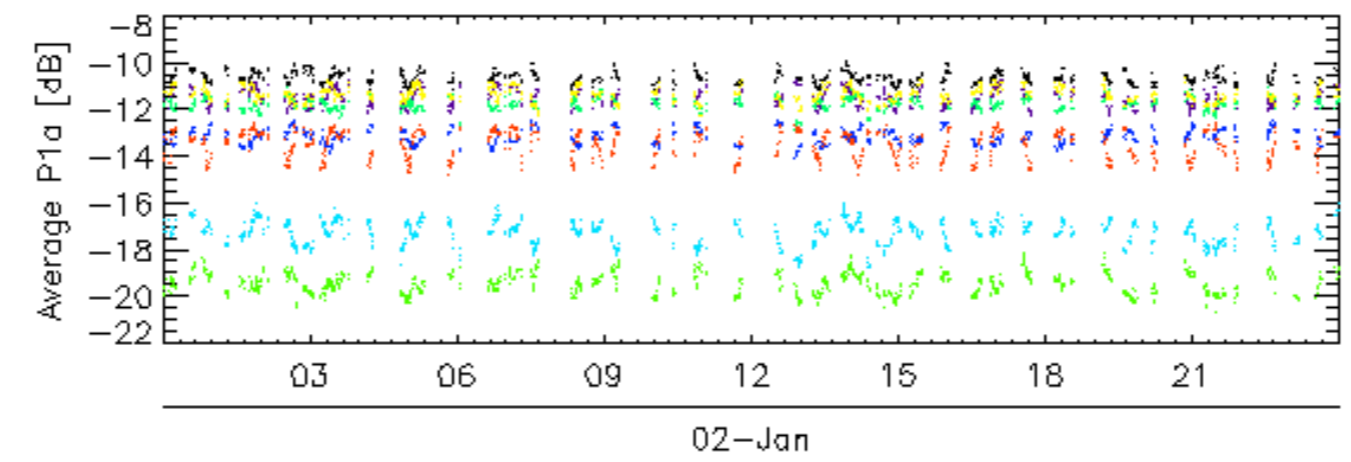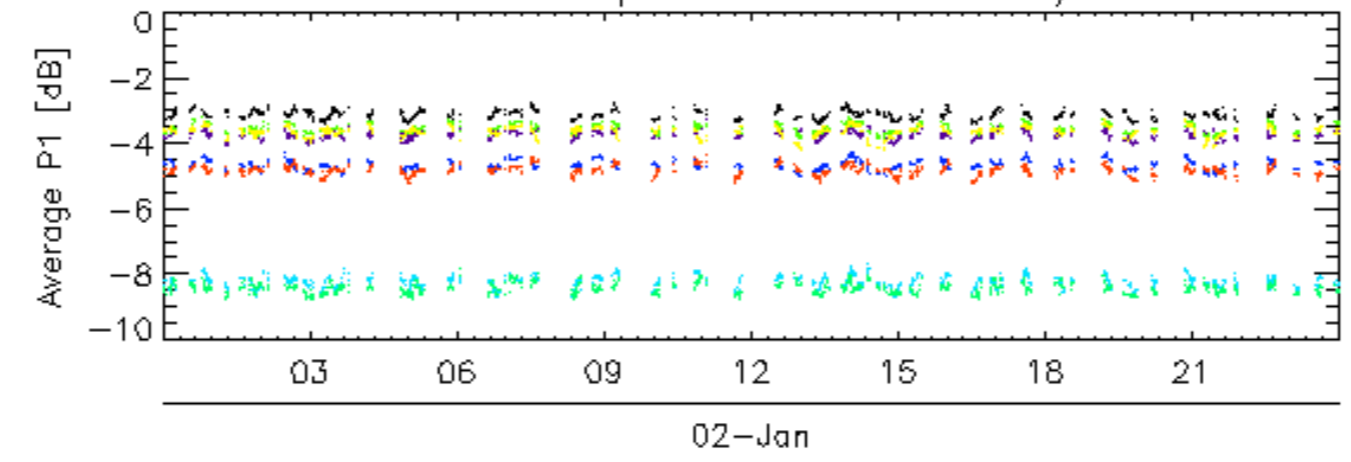


rows: 1 13 17 21 25 29 5 9

Calibration pulses for GM1 SS3 H/H

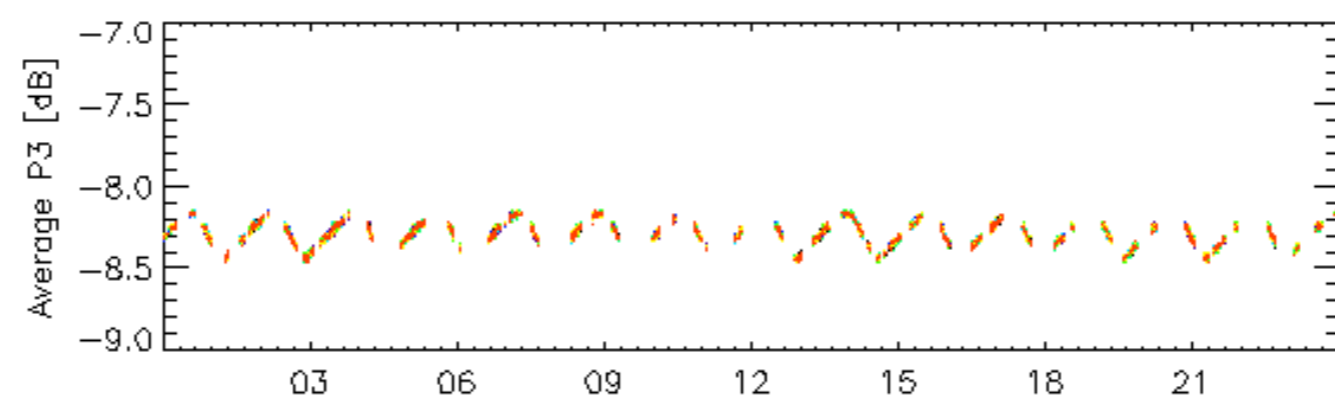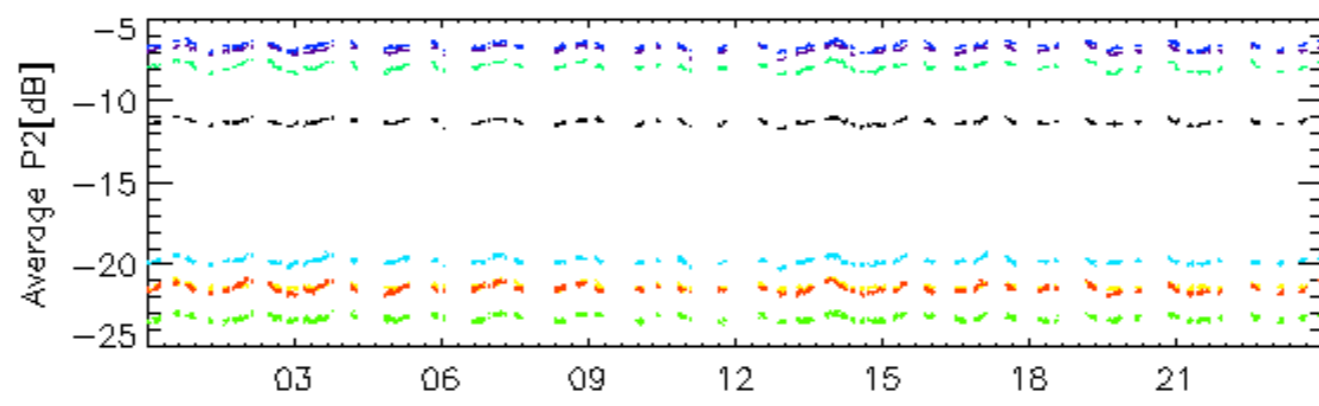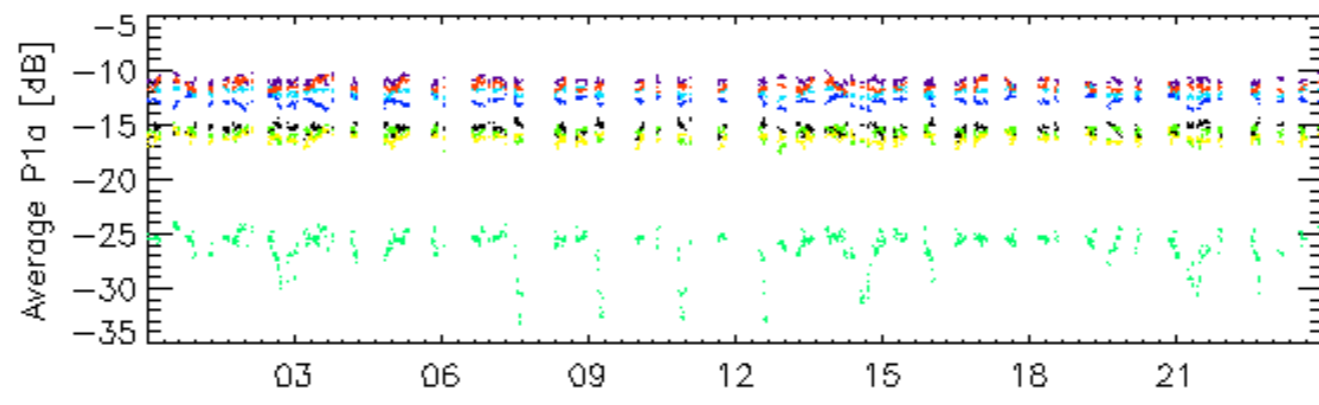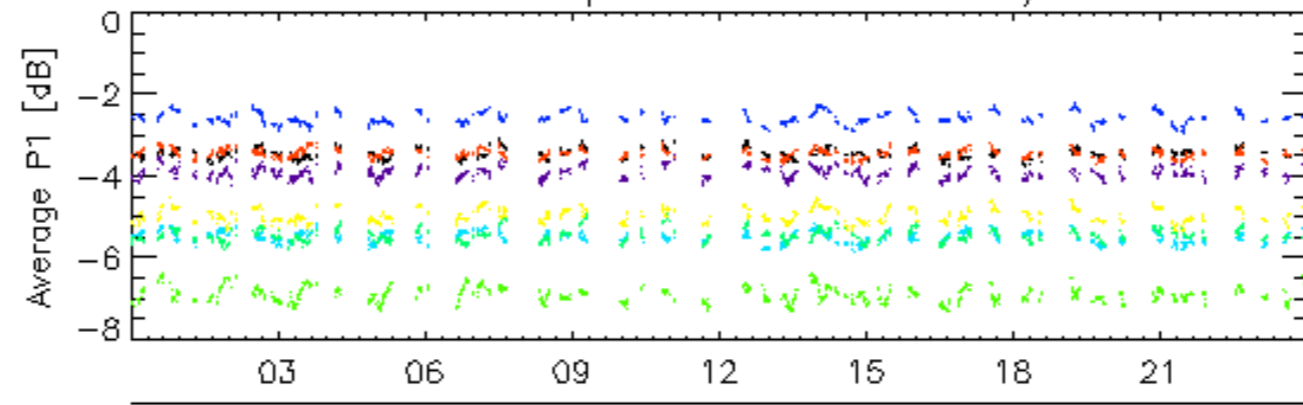


rows: _ 10 _ 14 _ 18 _ 2 _ 22 _ 26 _ 30 _ 6





Calibration pulses for GM1 SS3 H/H

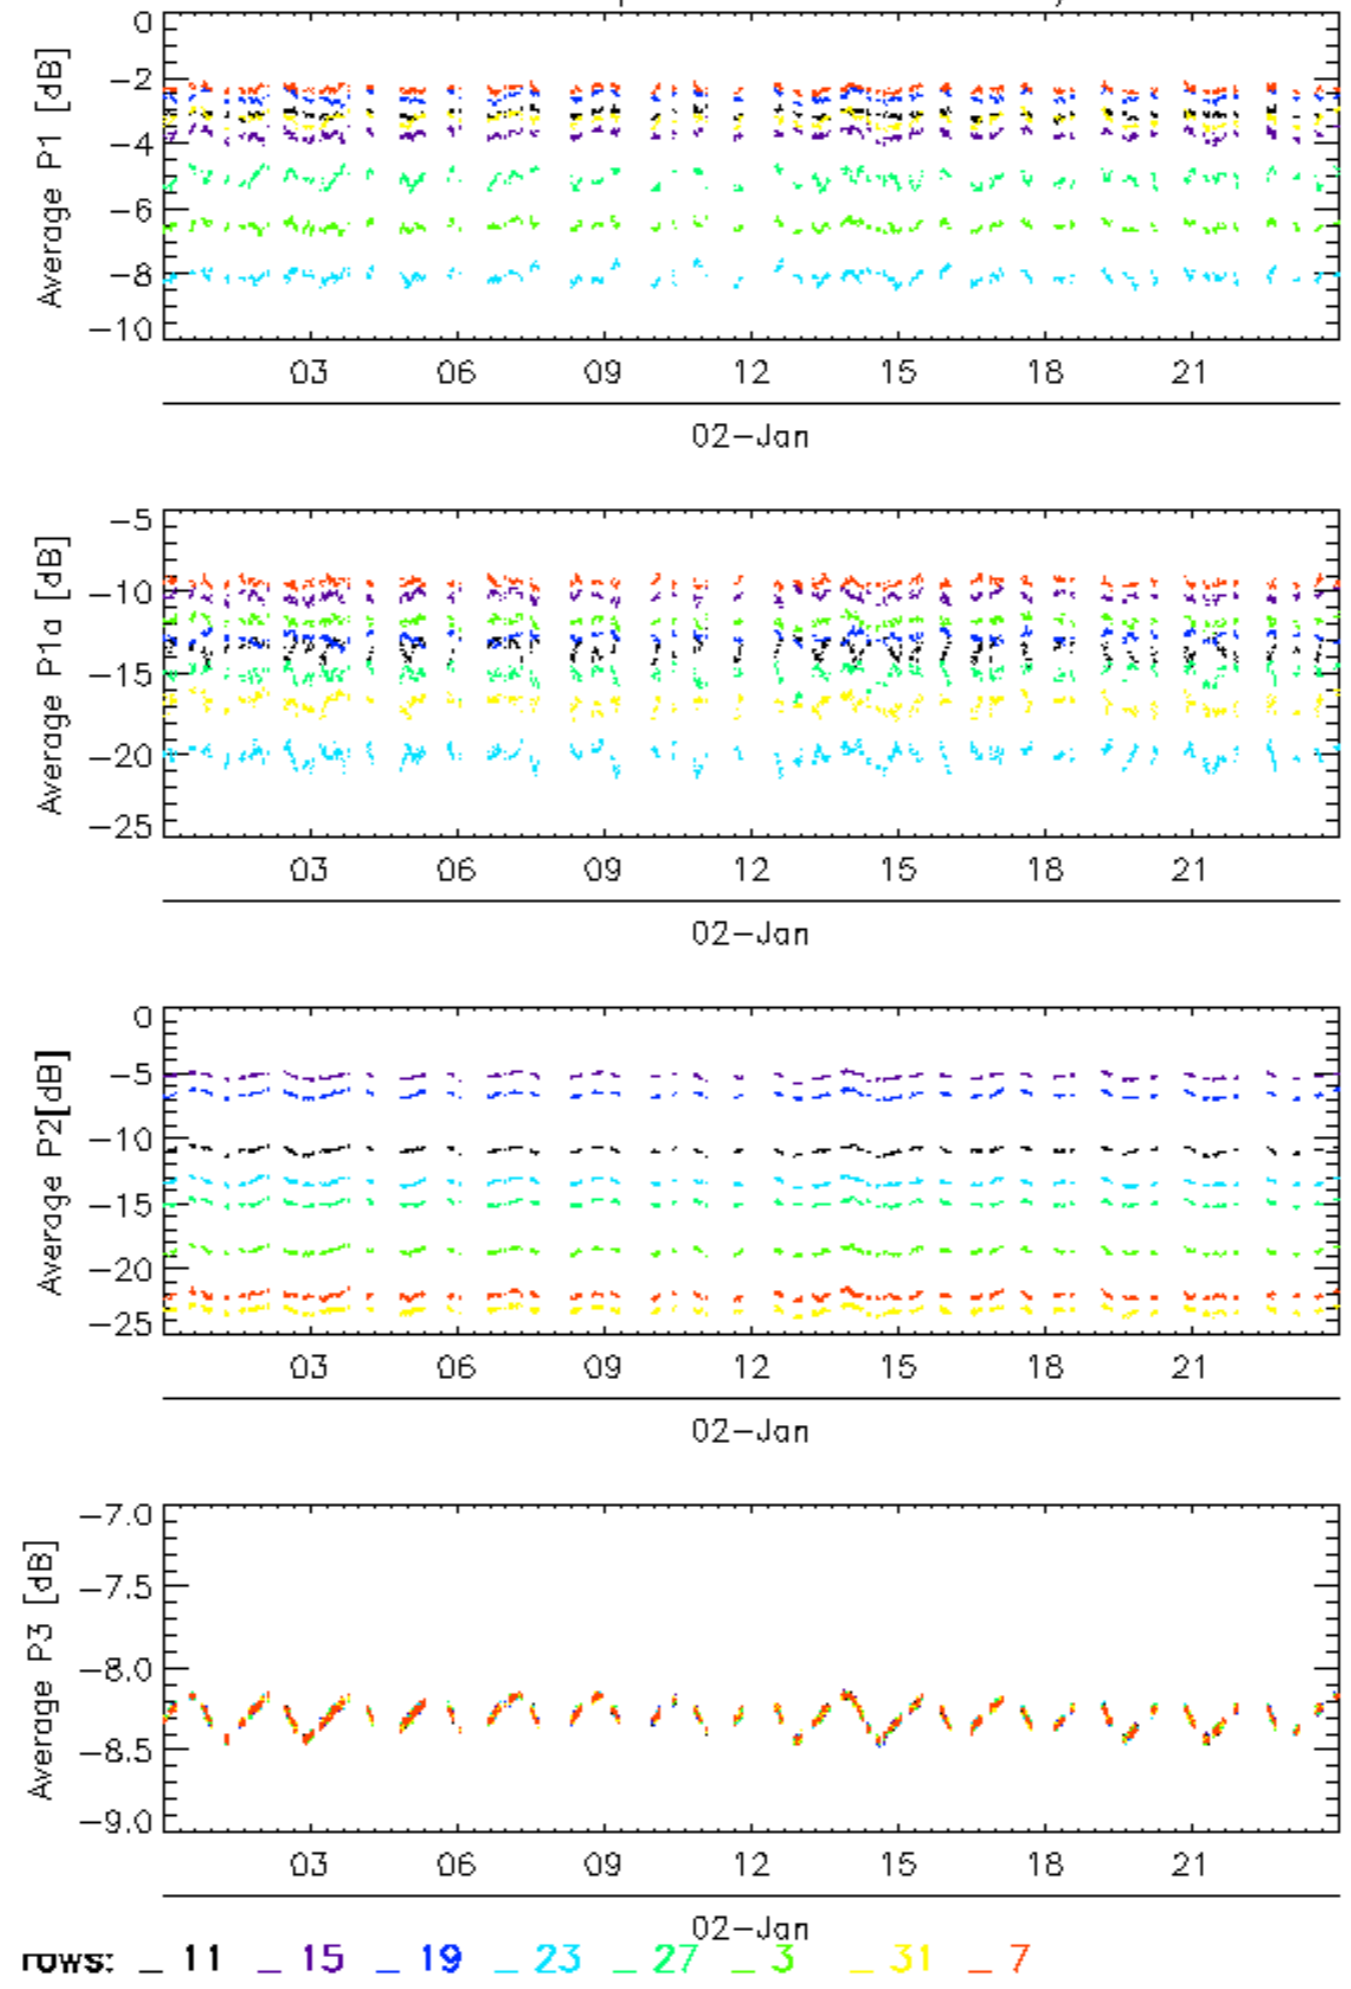

Calibration pulses for GM1 SS3 H/H

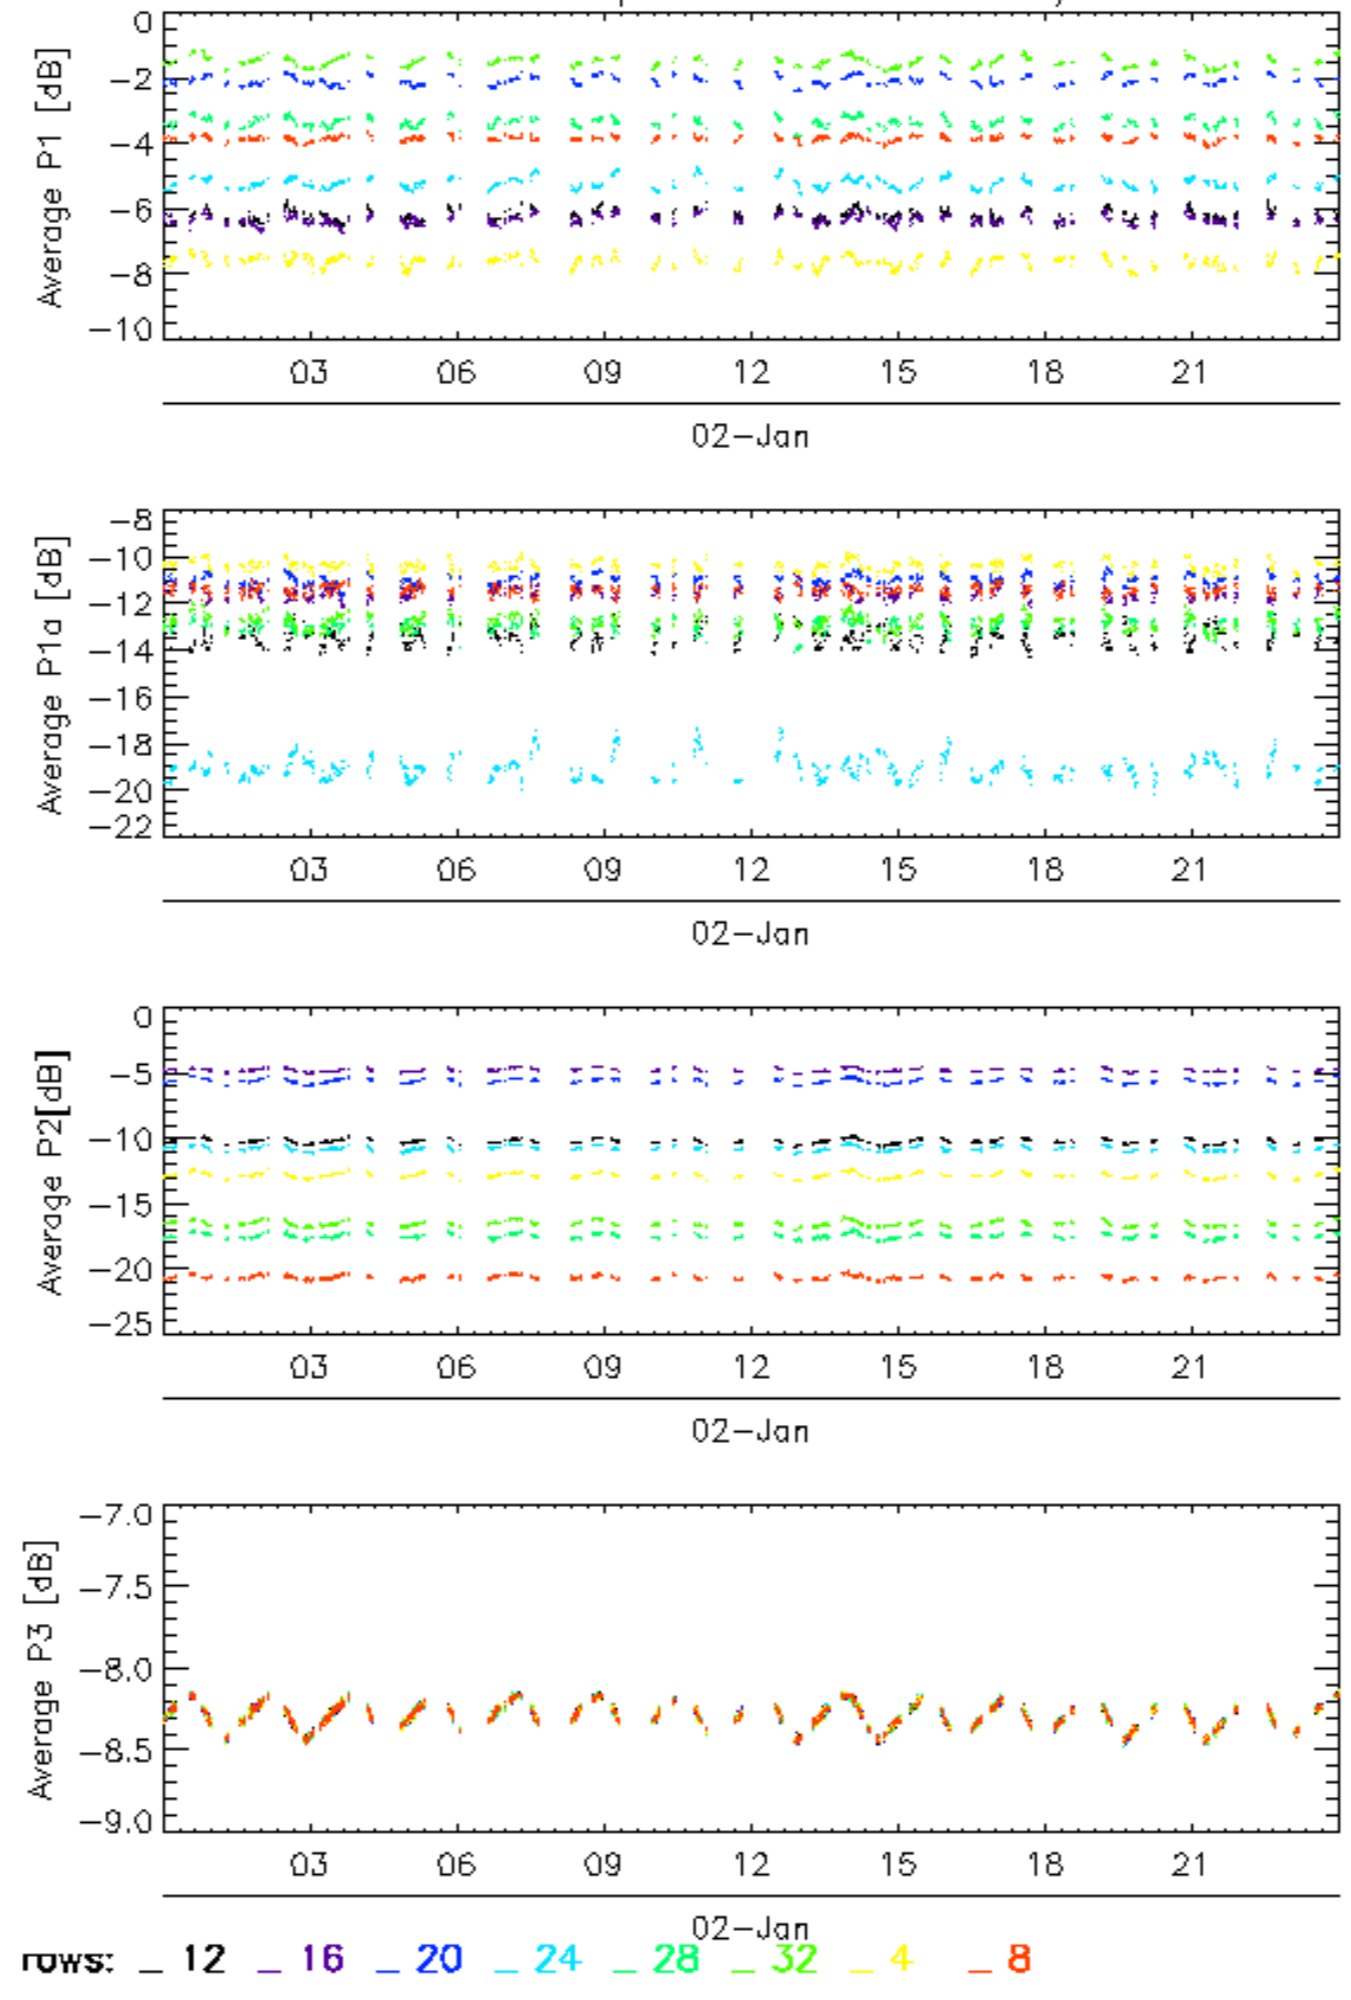


Calibration pulses for WVS IS2 V/V

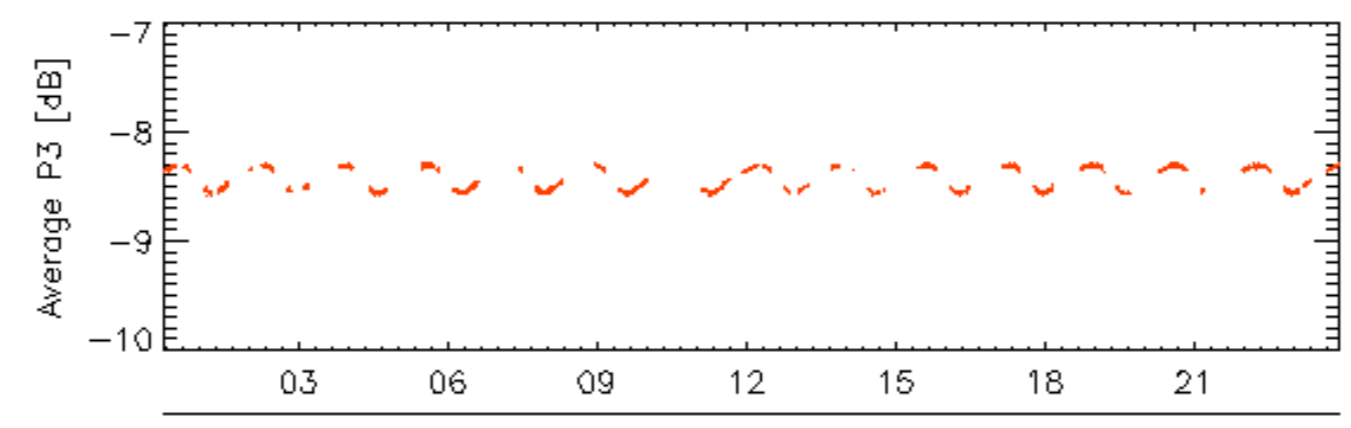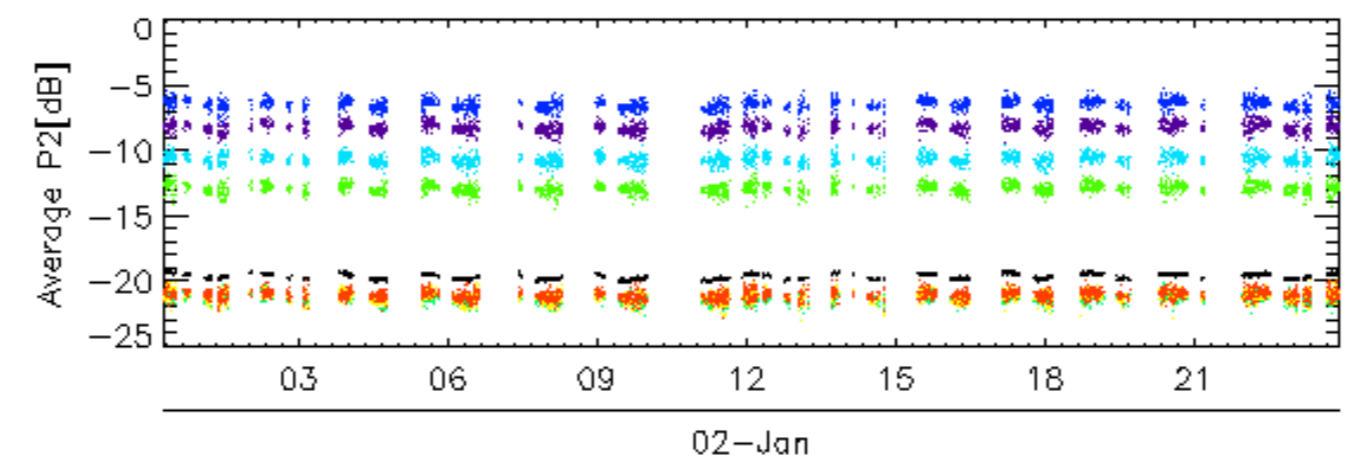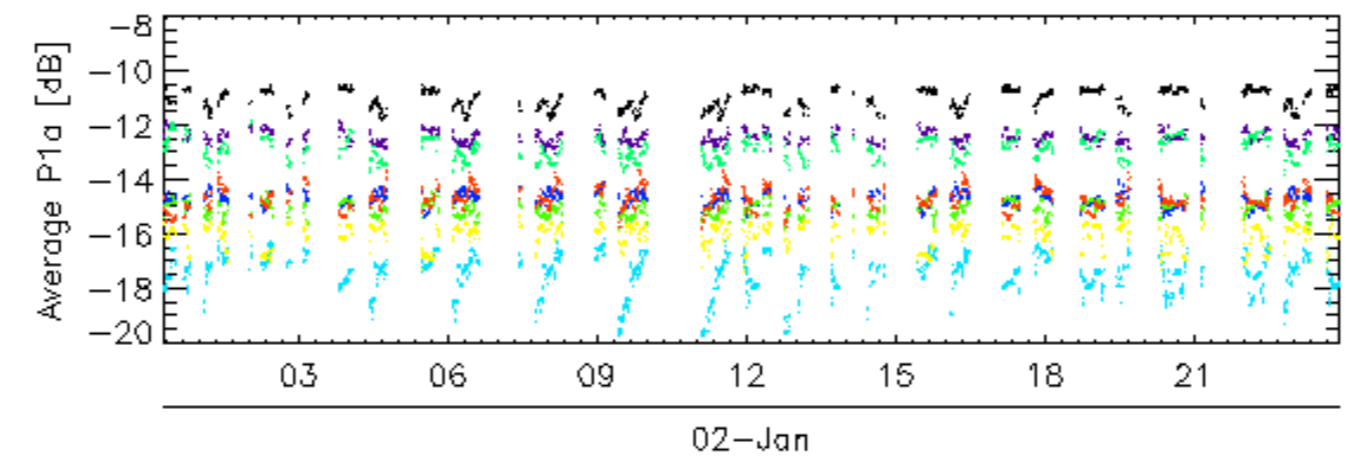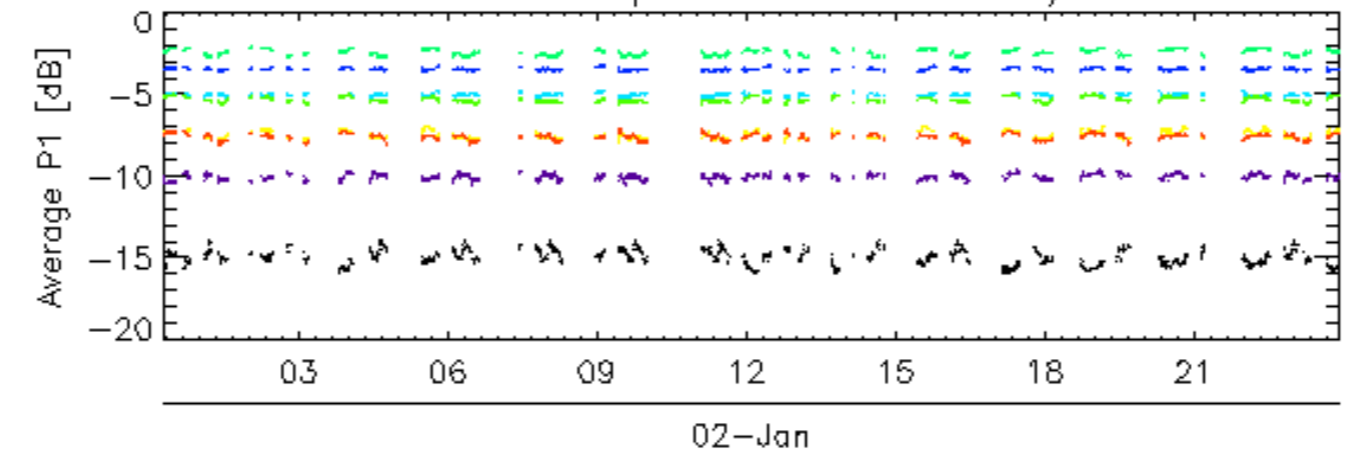


rows: 1 13 17 21 25 29 5 9


Calibration pulses for WVS IS2 V/V

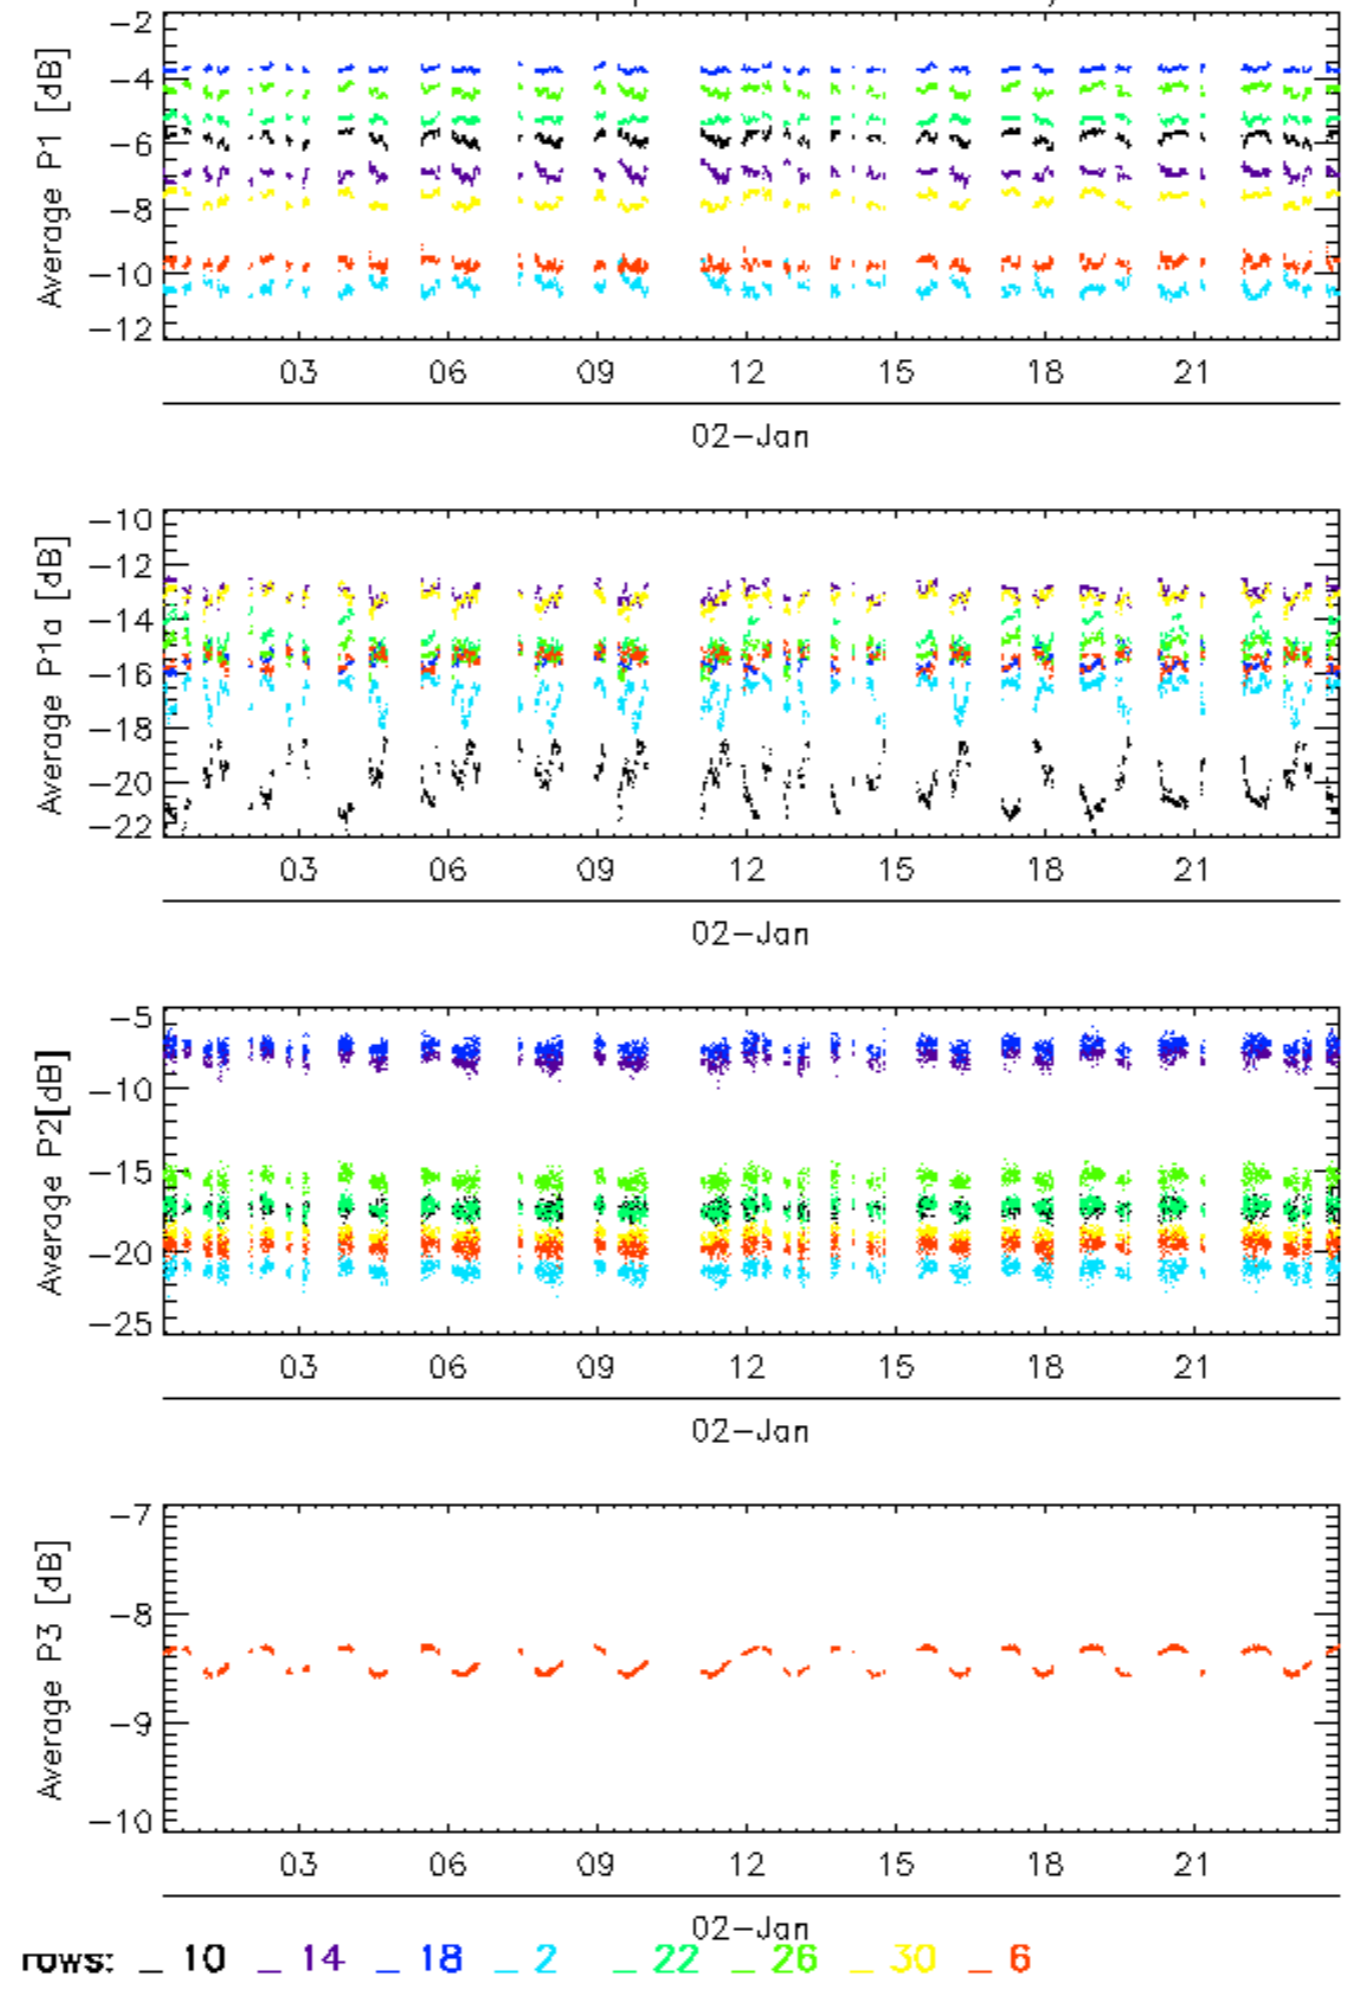


Calibration pulses for WVS IS2 V/V

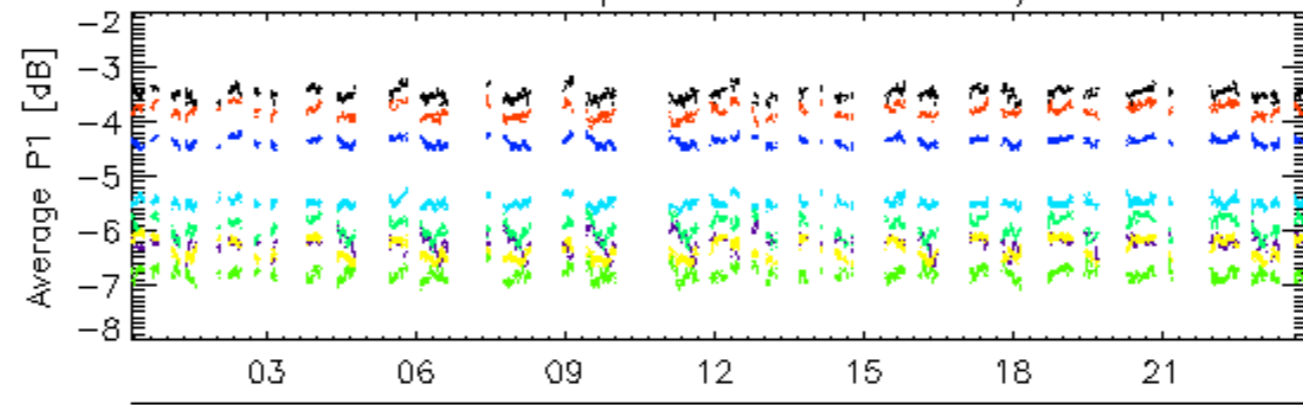


02-Jan

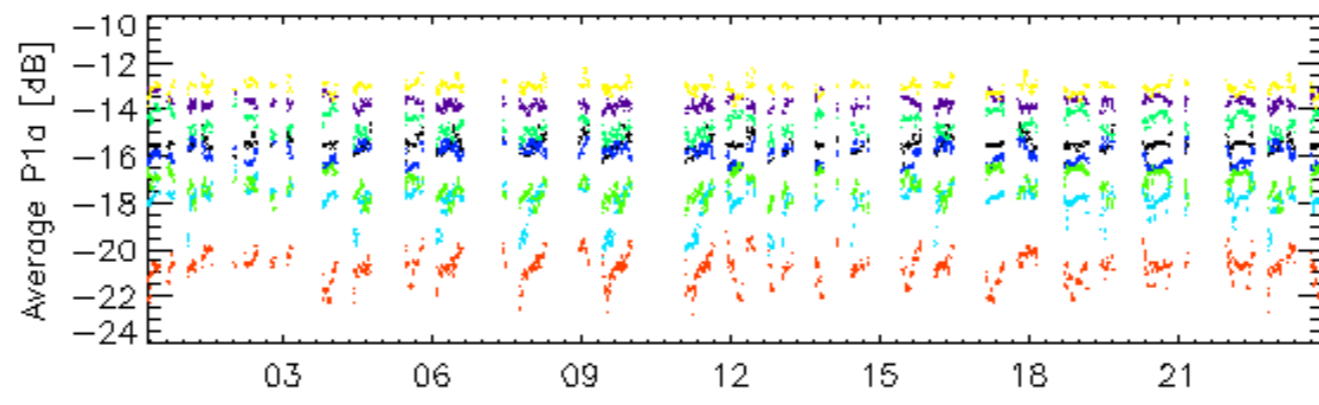

02-Jan

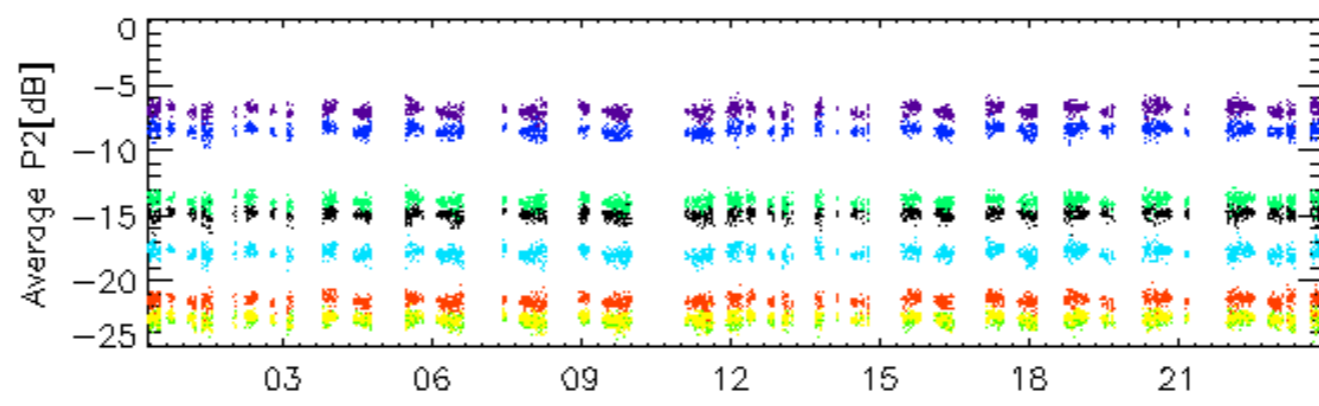


02-Jan

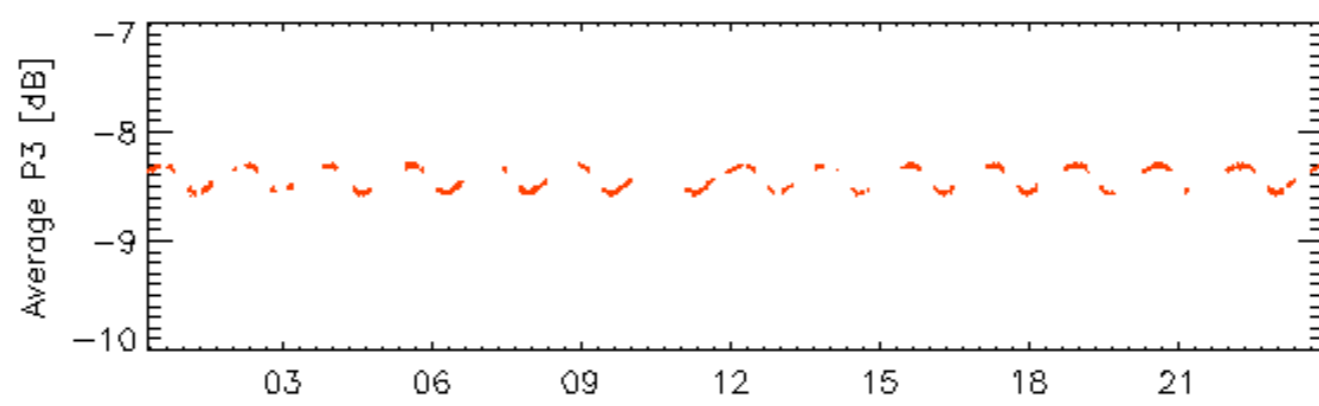


02-Jan

rows: _ 11 _ 15 _ 19 _ 23 _ 27 _ 3 _ 31 _ 7


Calibration pulses for WVS IS2 V/V

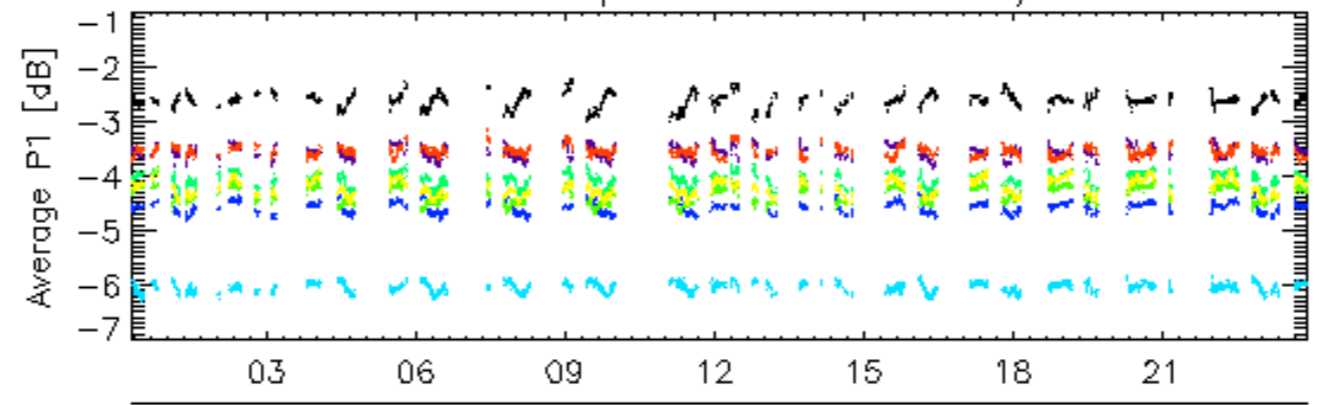


02-Jan

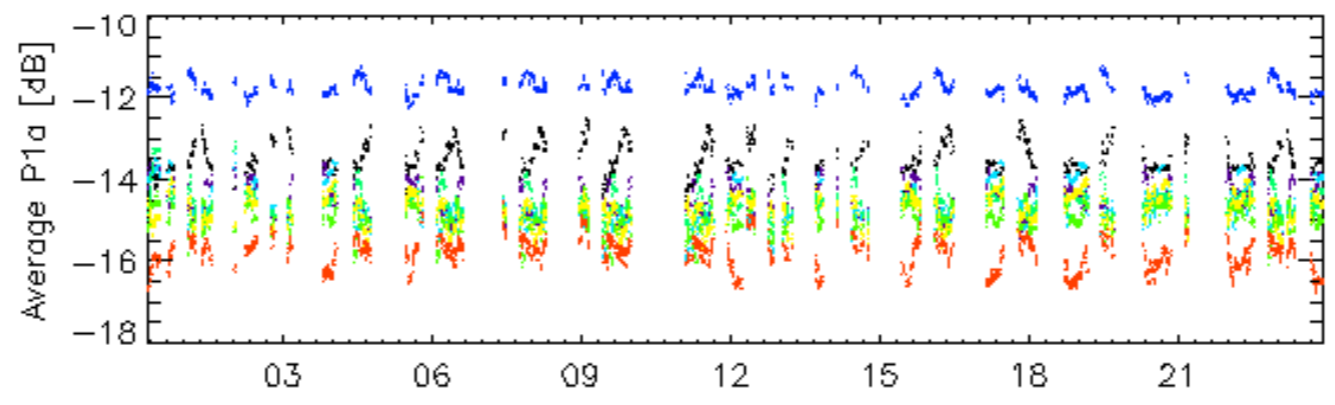

02-Jan

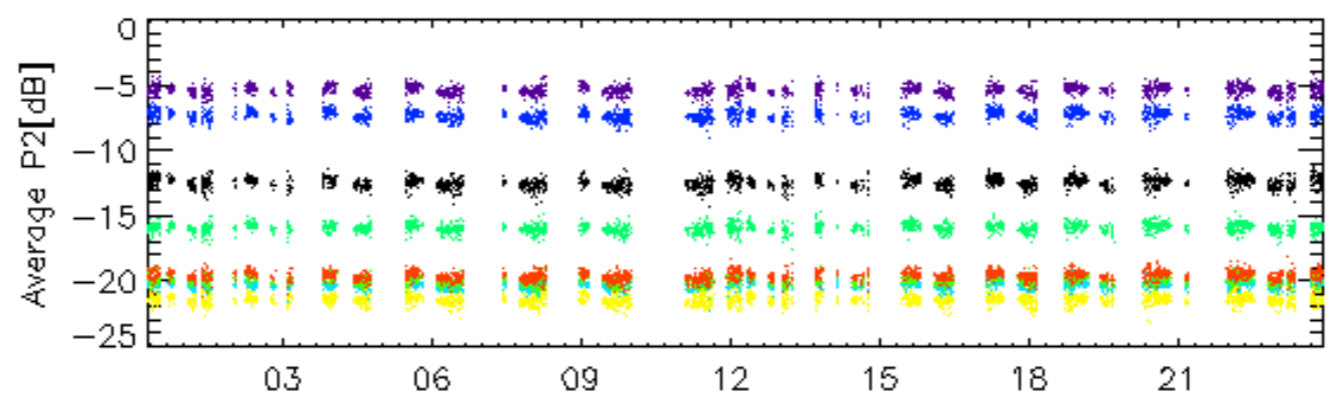



02-Jan


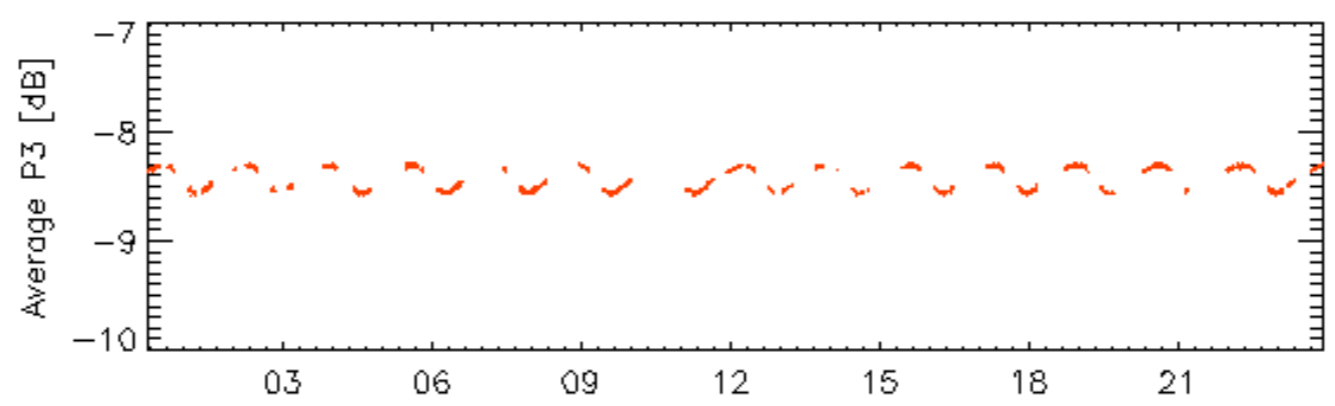




02-Jan

rows: _ 12 _ 16 _ 20 _ 24 _ 28 _ 32 _ 4 _ 8


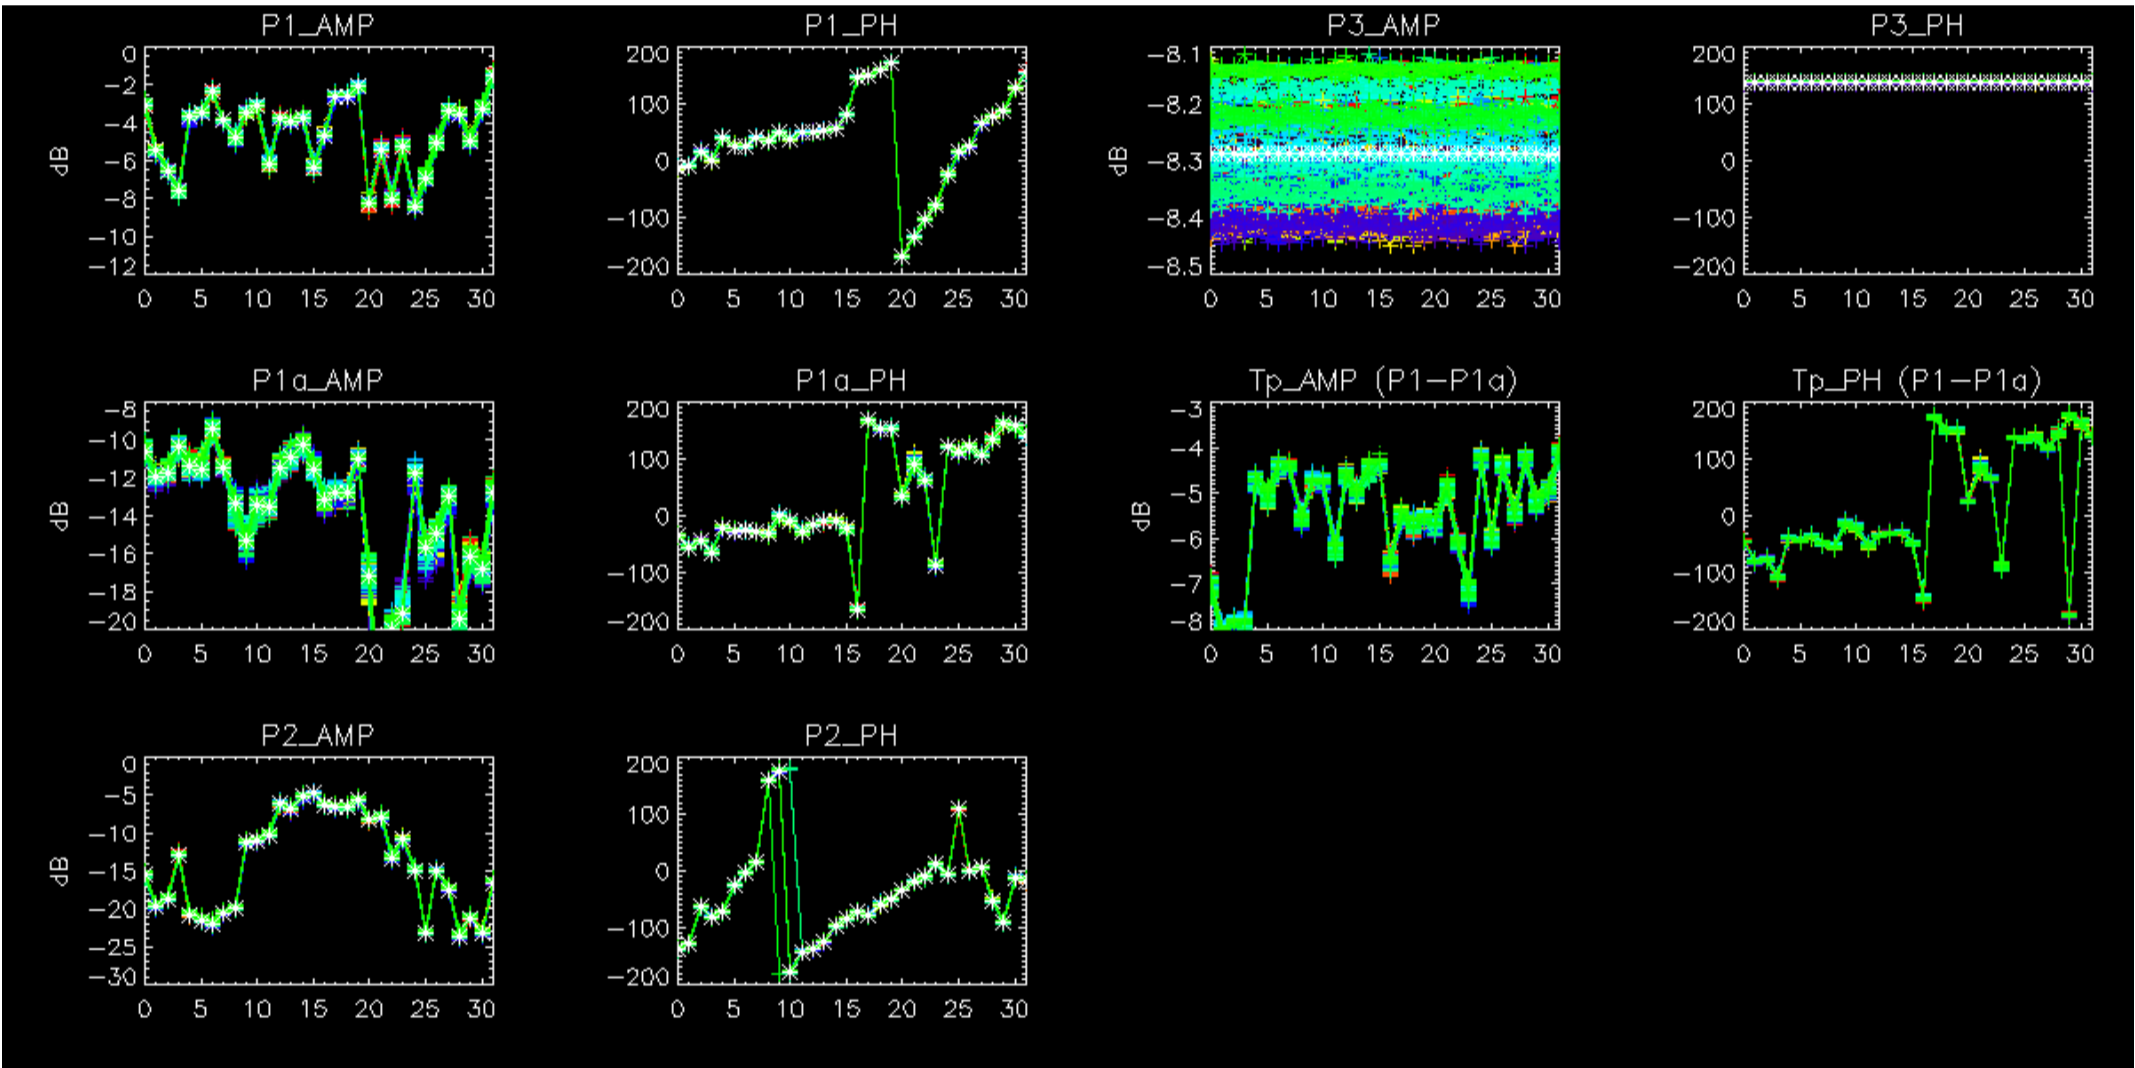


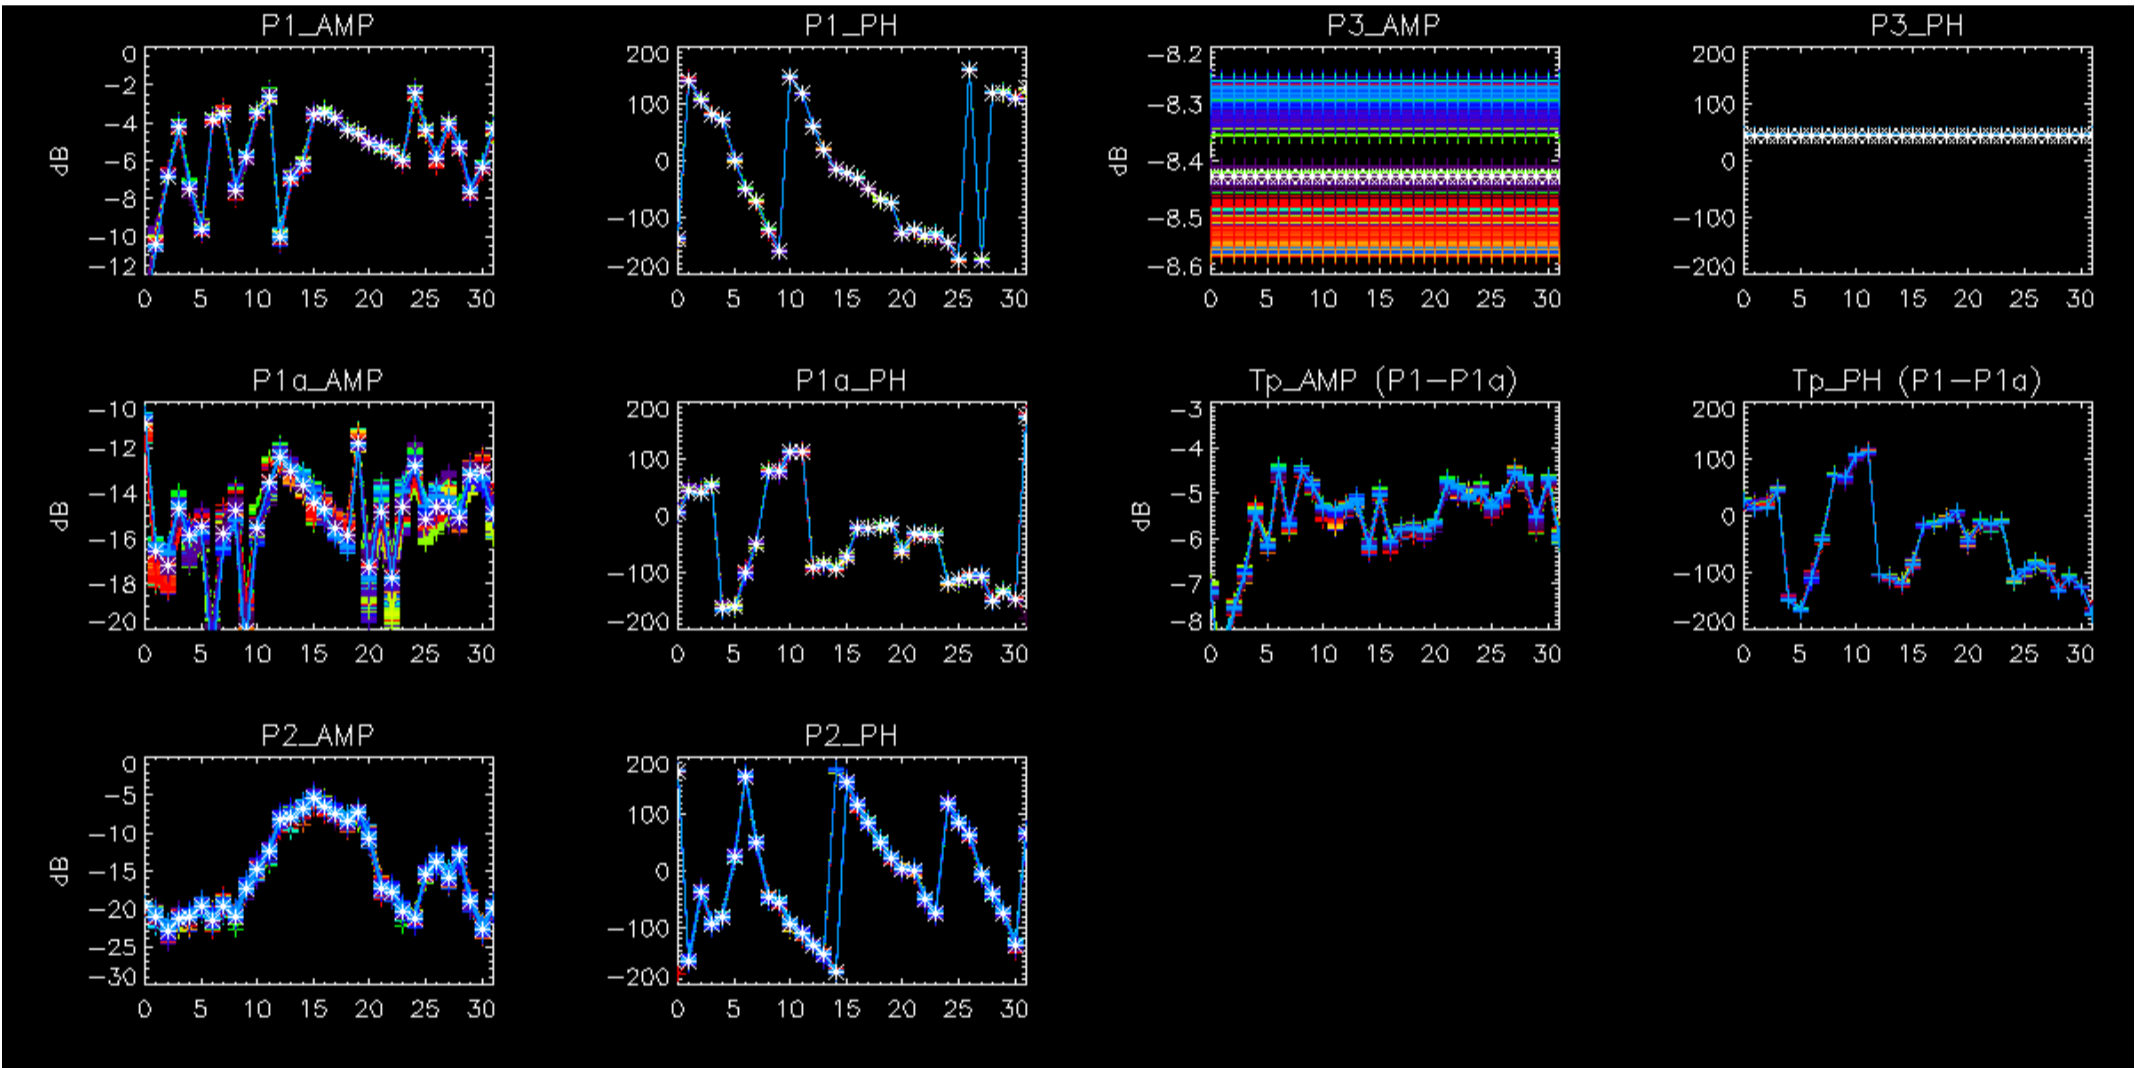

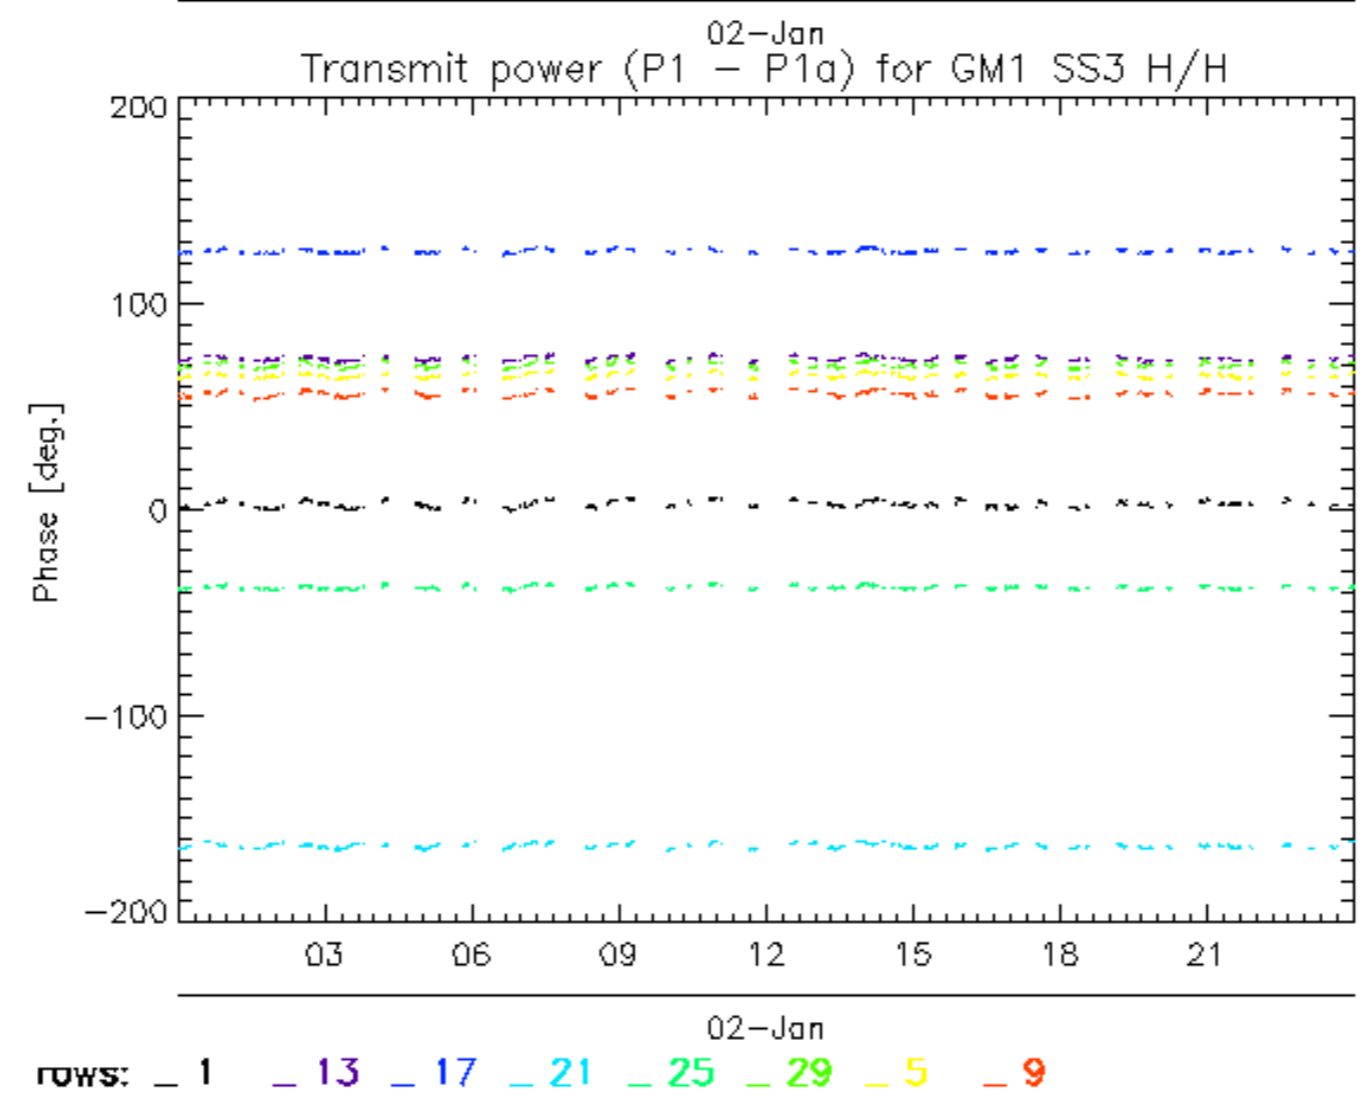
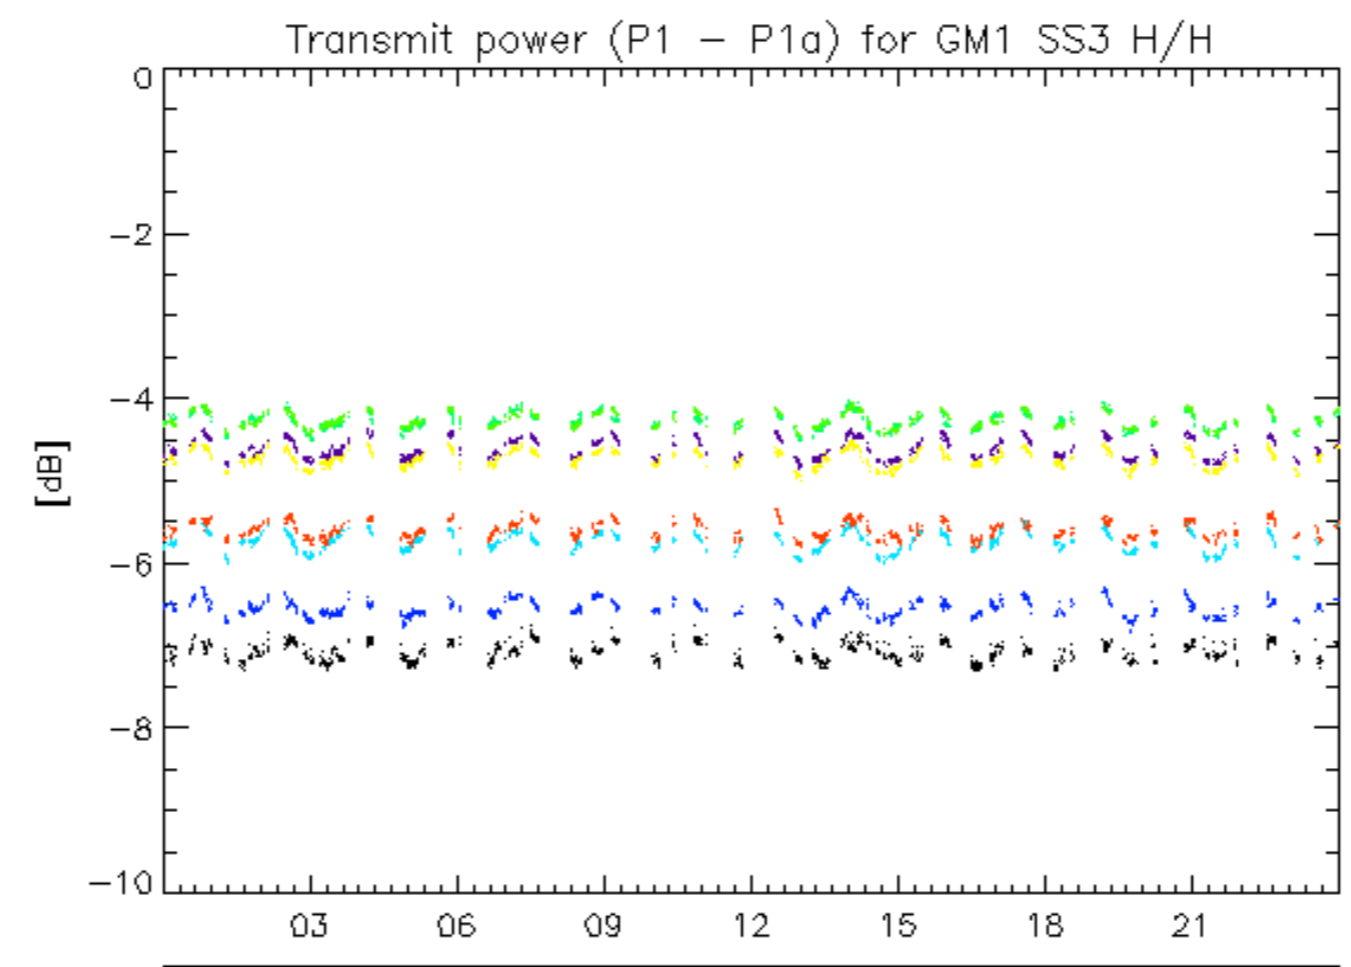


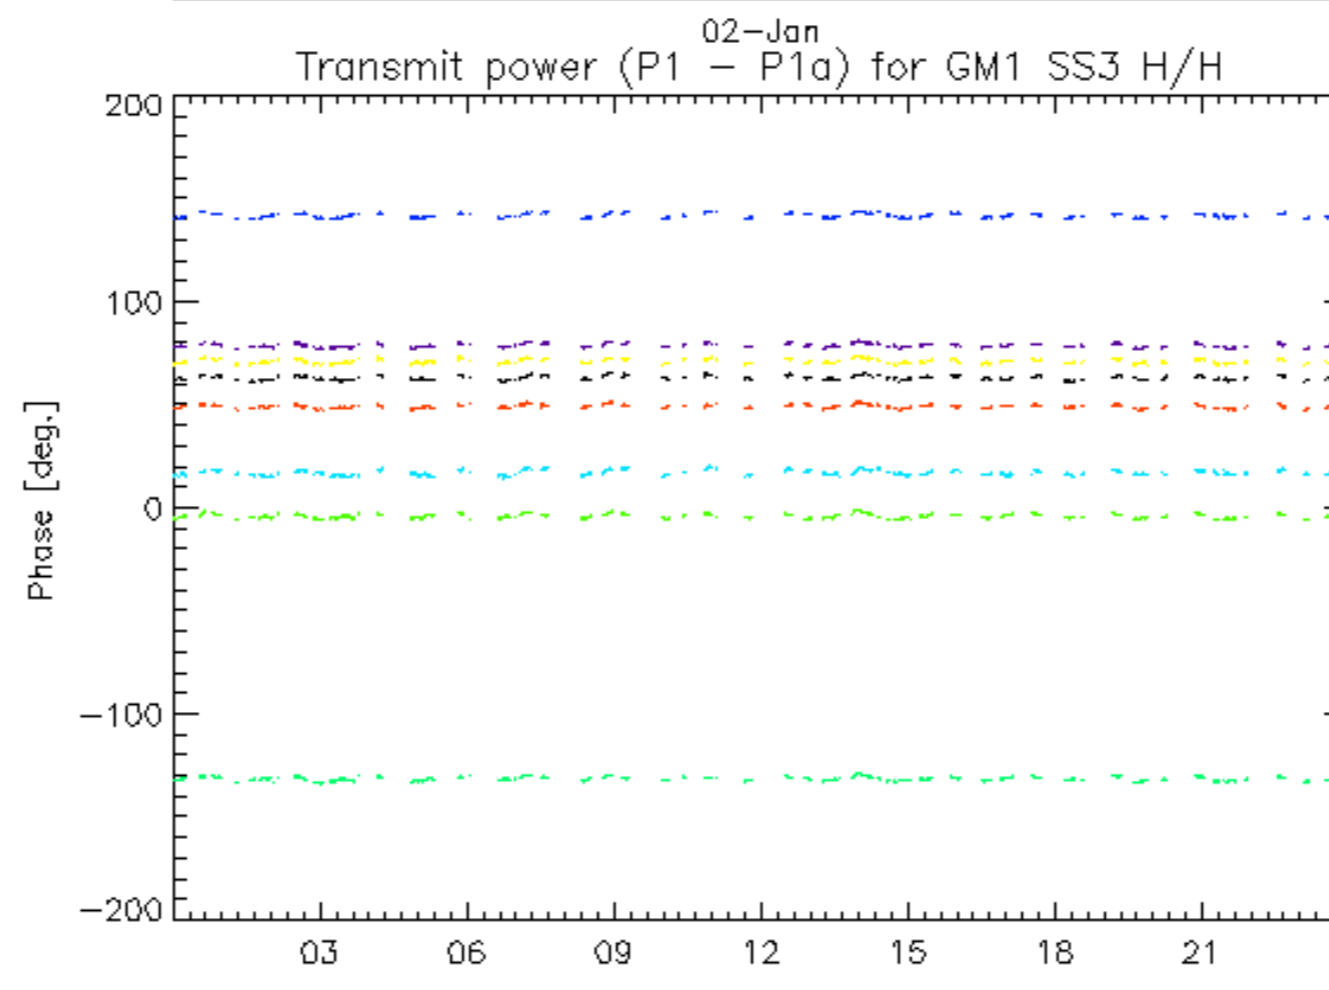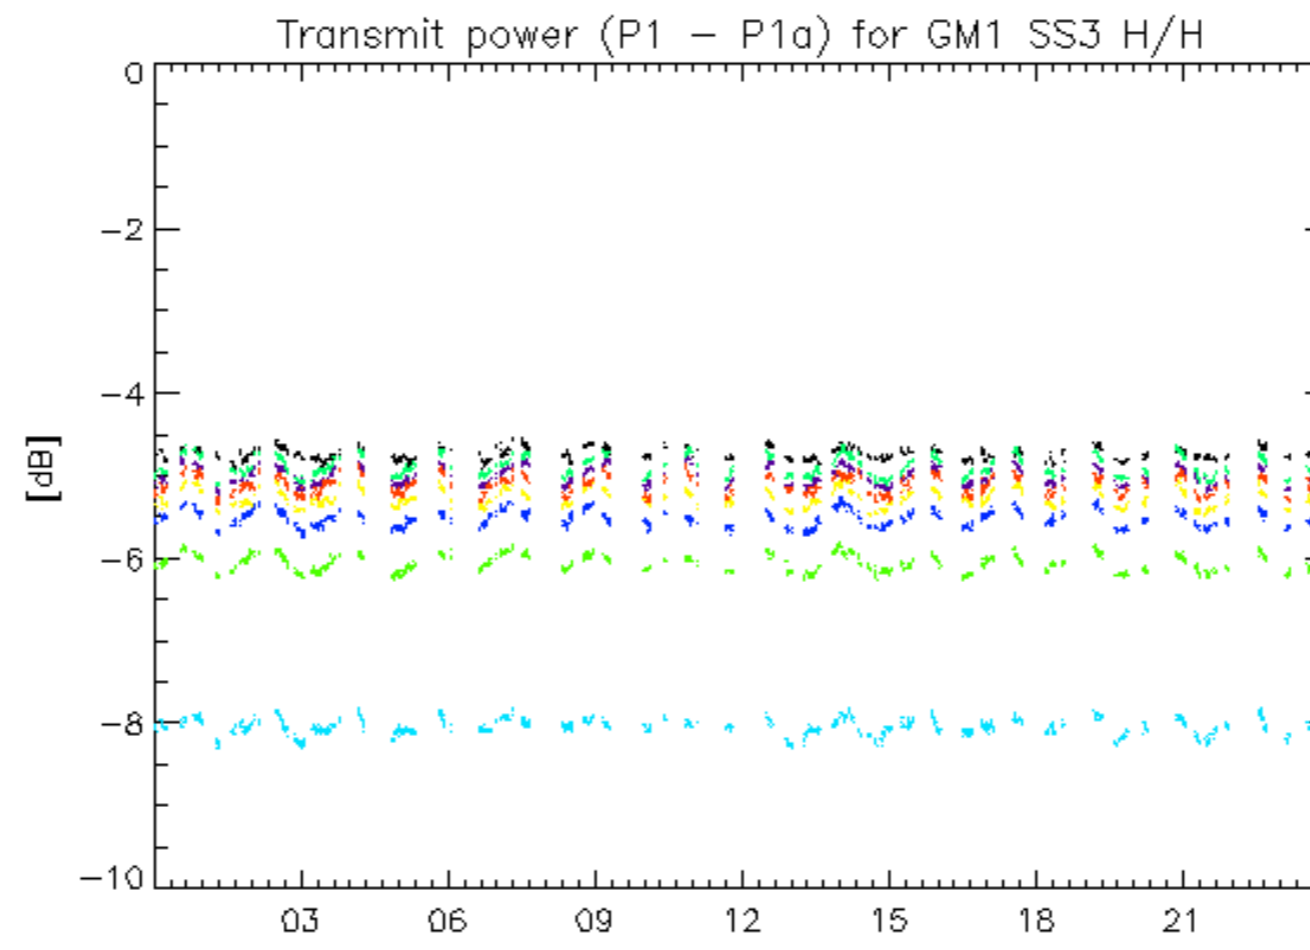



02-Jan
rows: _ 10 _ 14 _ 18 _ 2 _ 22 _ 26 _ 30 _ 6

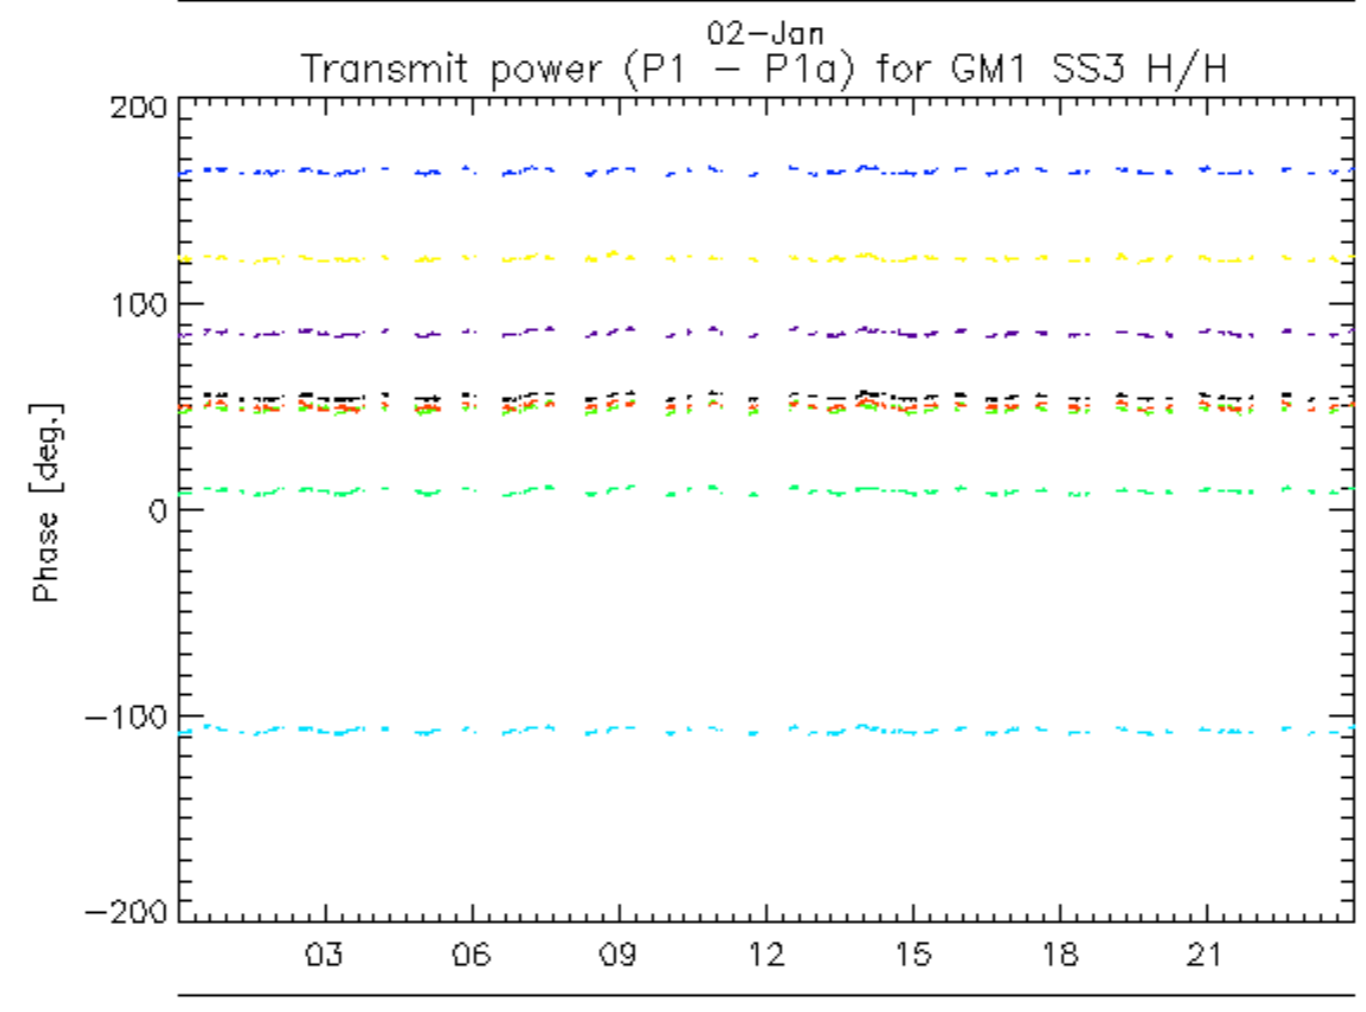
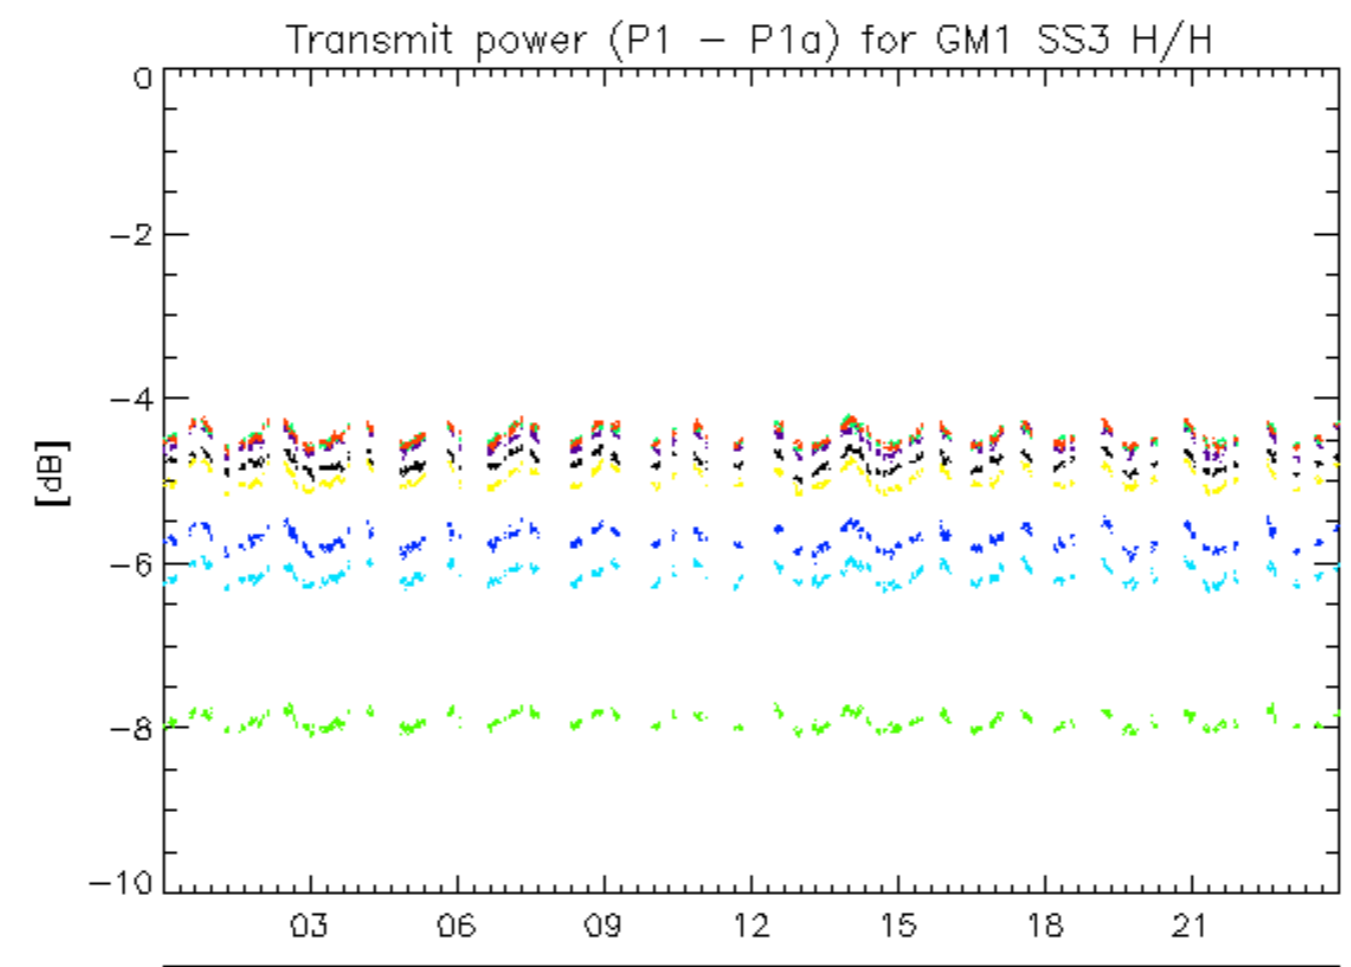




rows: _ 11 _ 15 _ 19 _ 23 _ 27 _ 31 _ 7

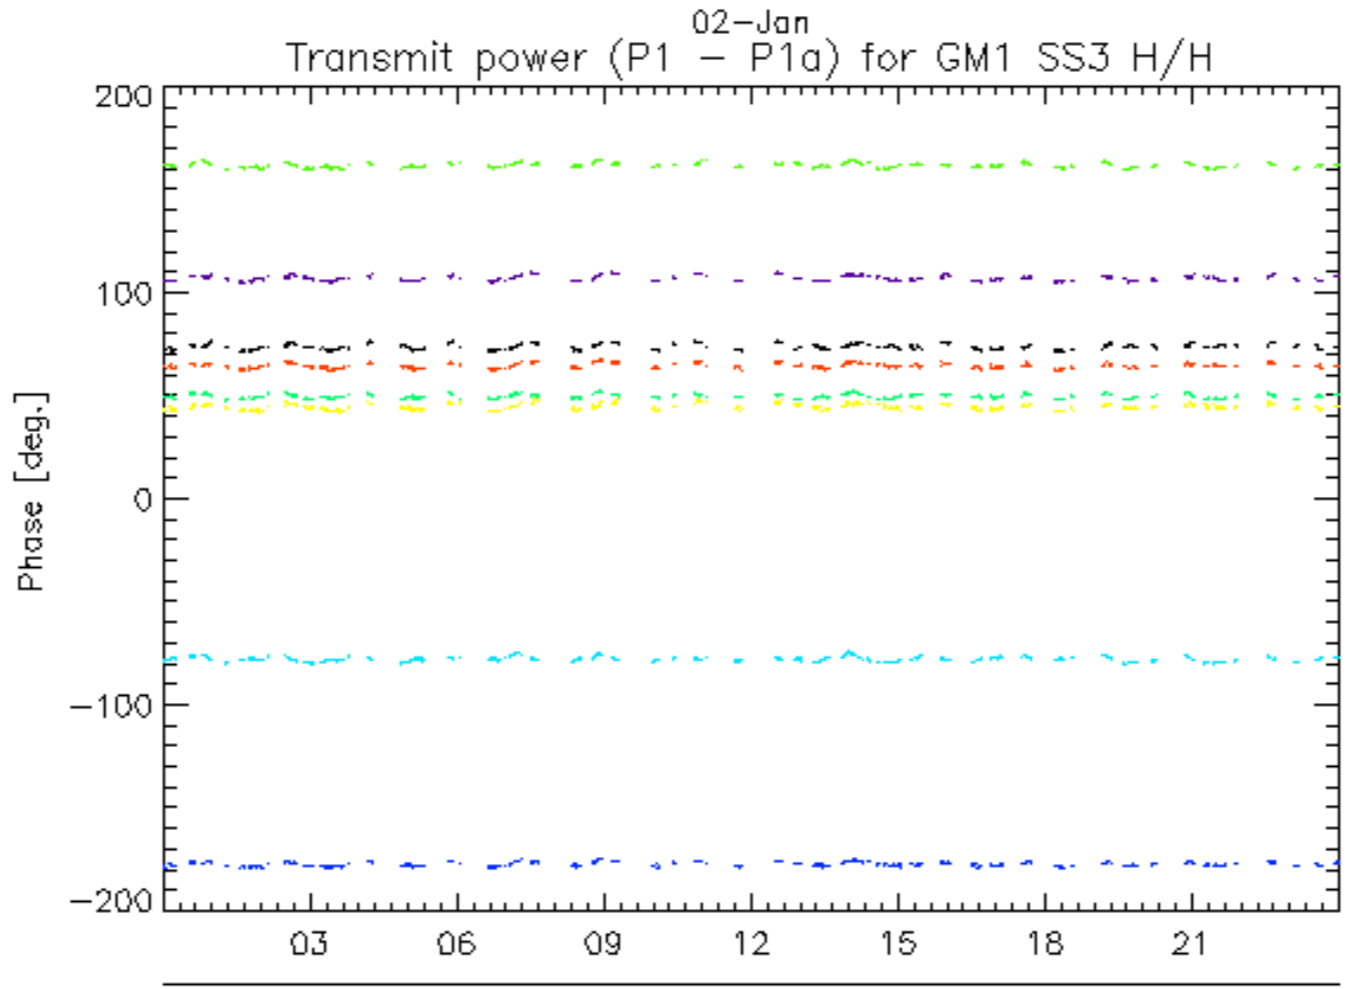
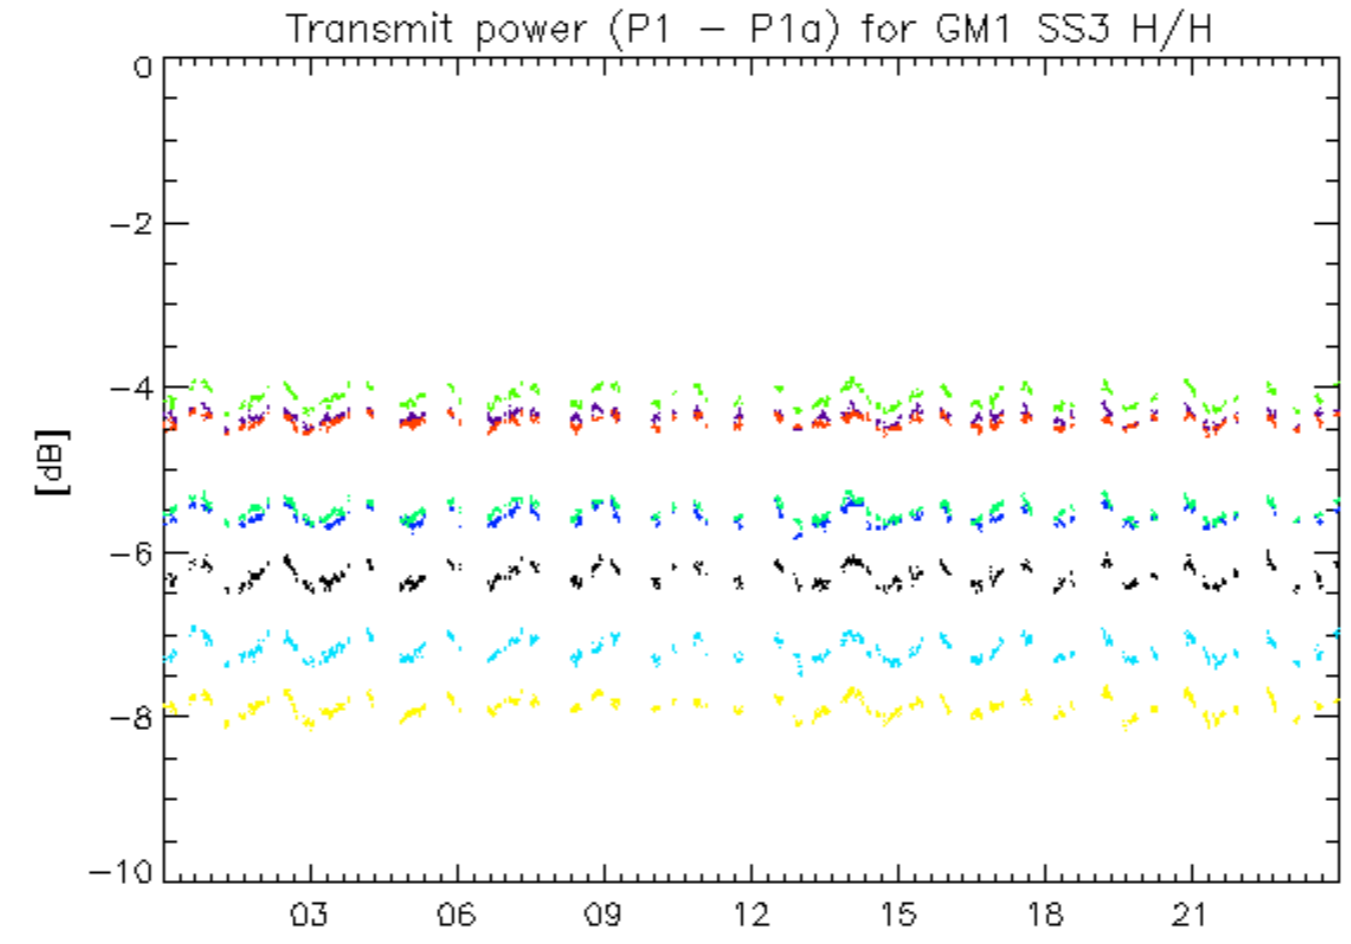



^{02-Jan}
rows: _ 12 _ 16 _ 20 _ 24 _ 28 _ 32 _ 4 _ 8

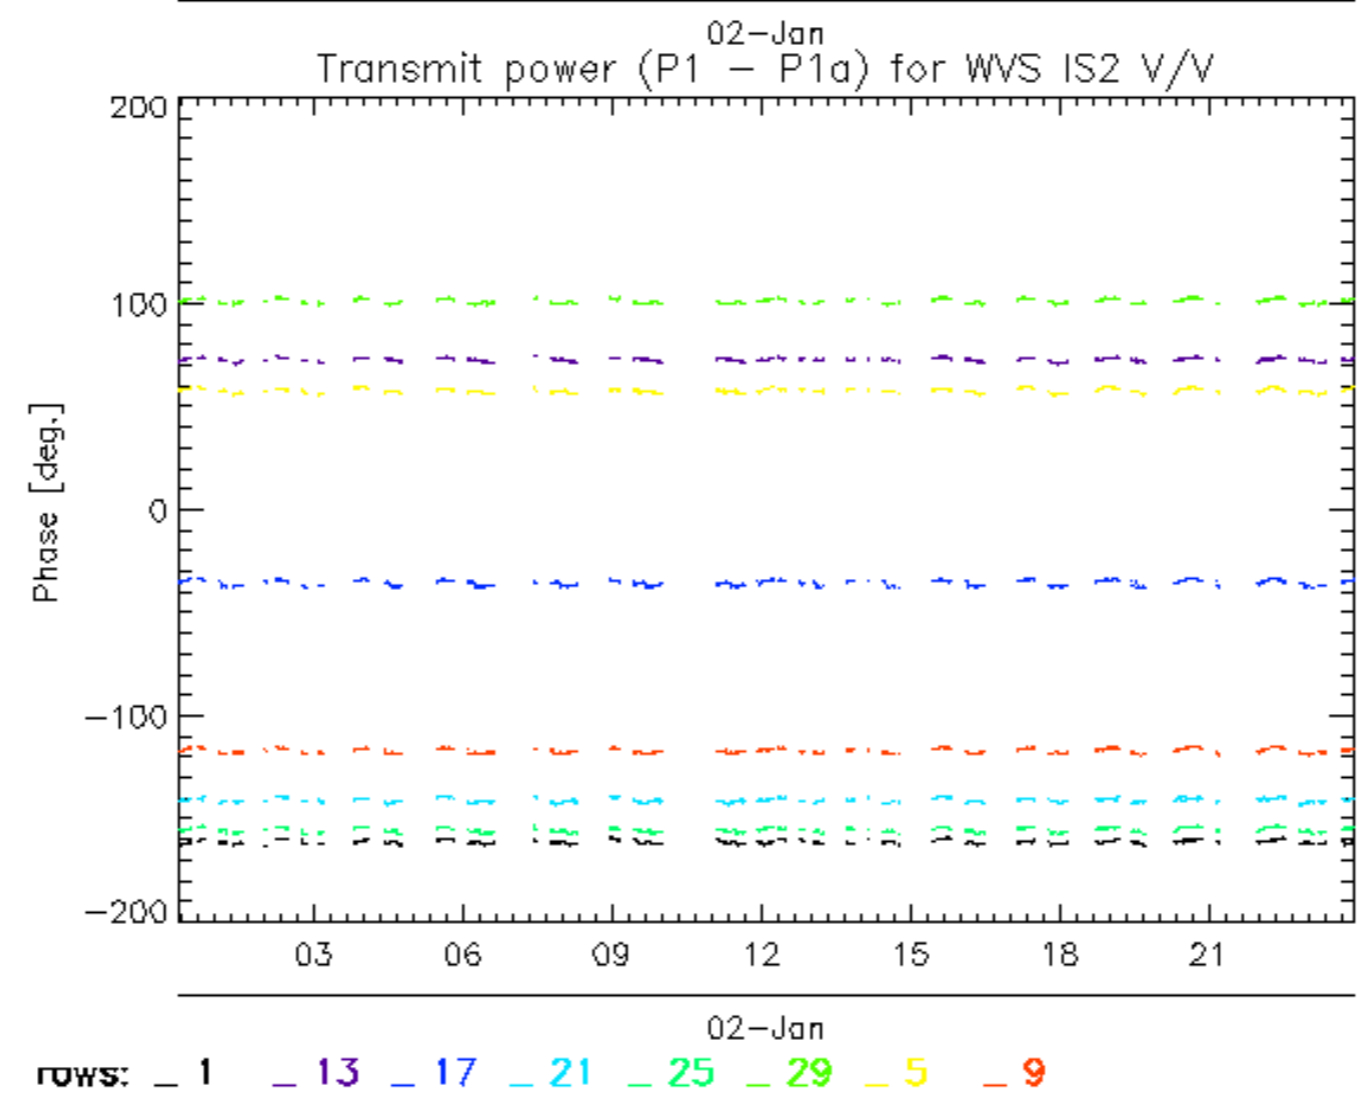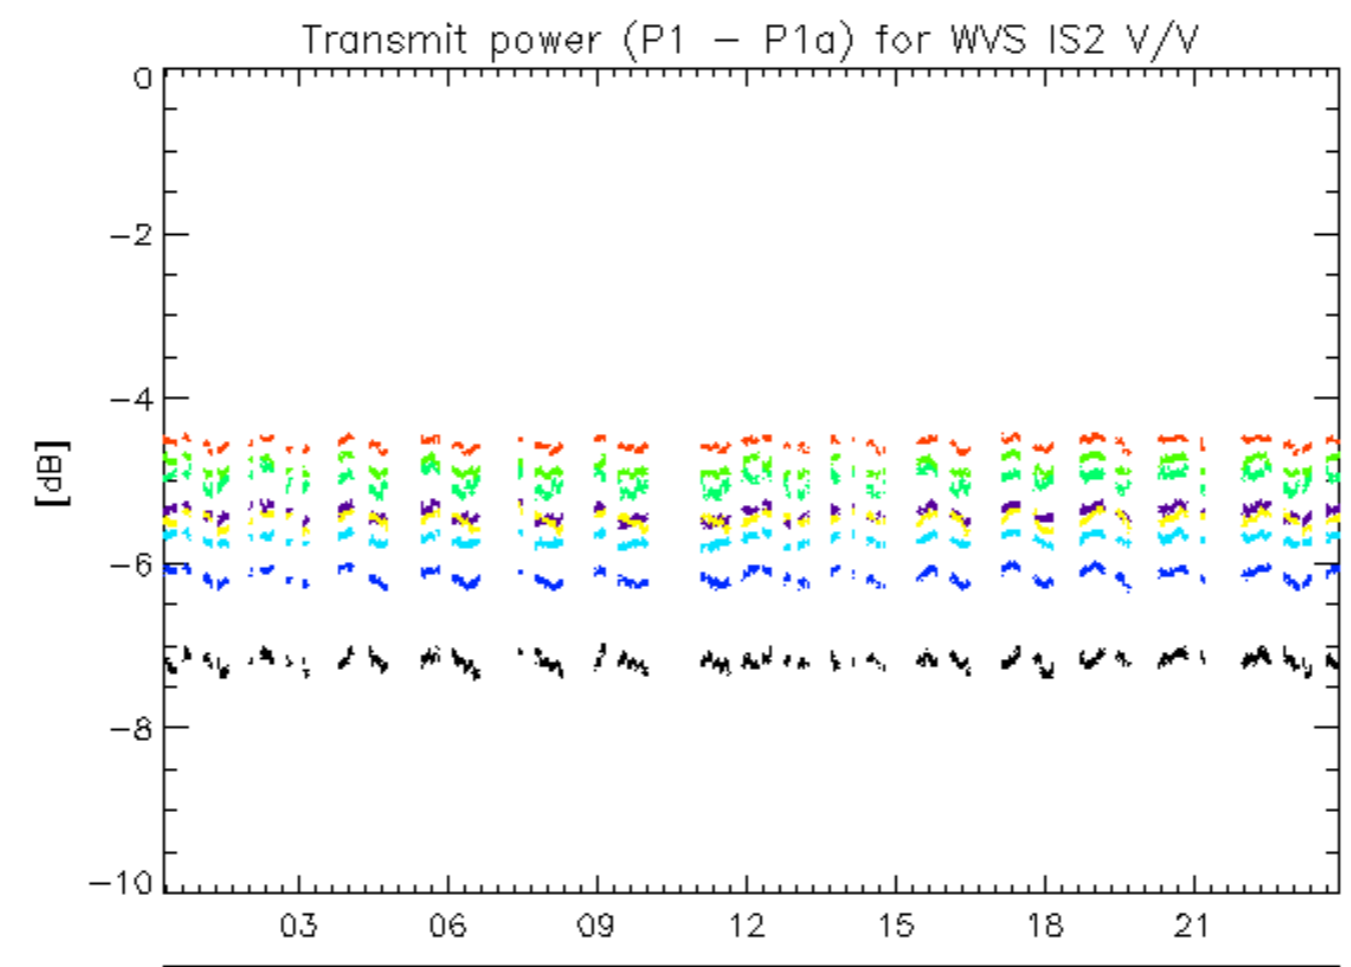


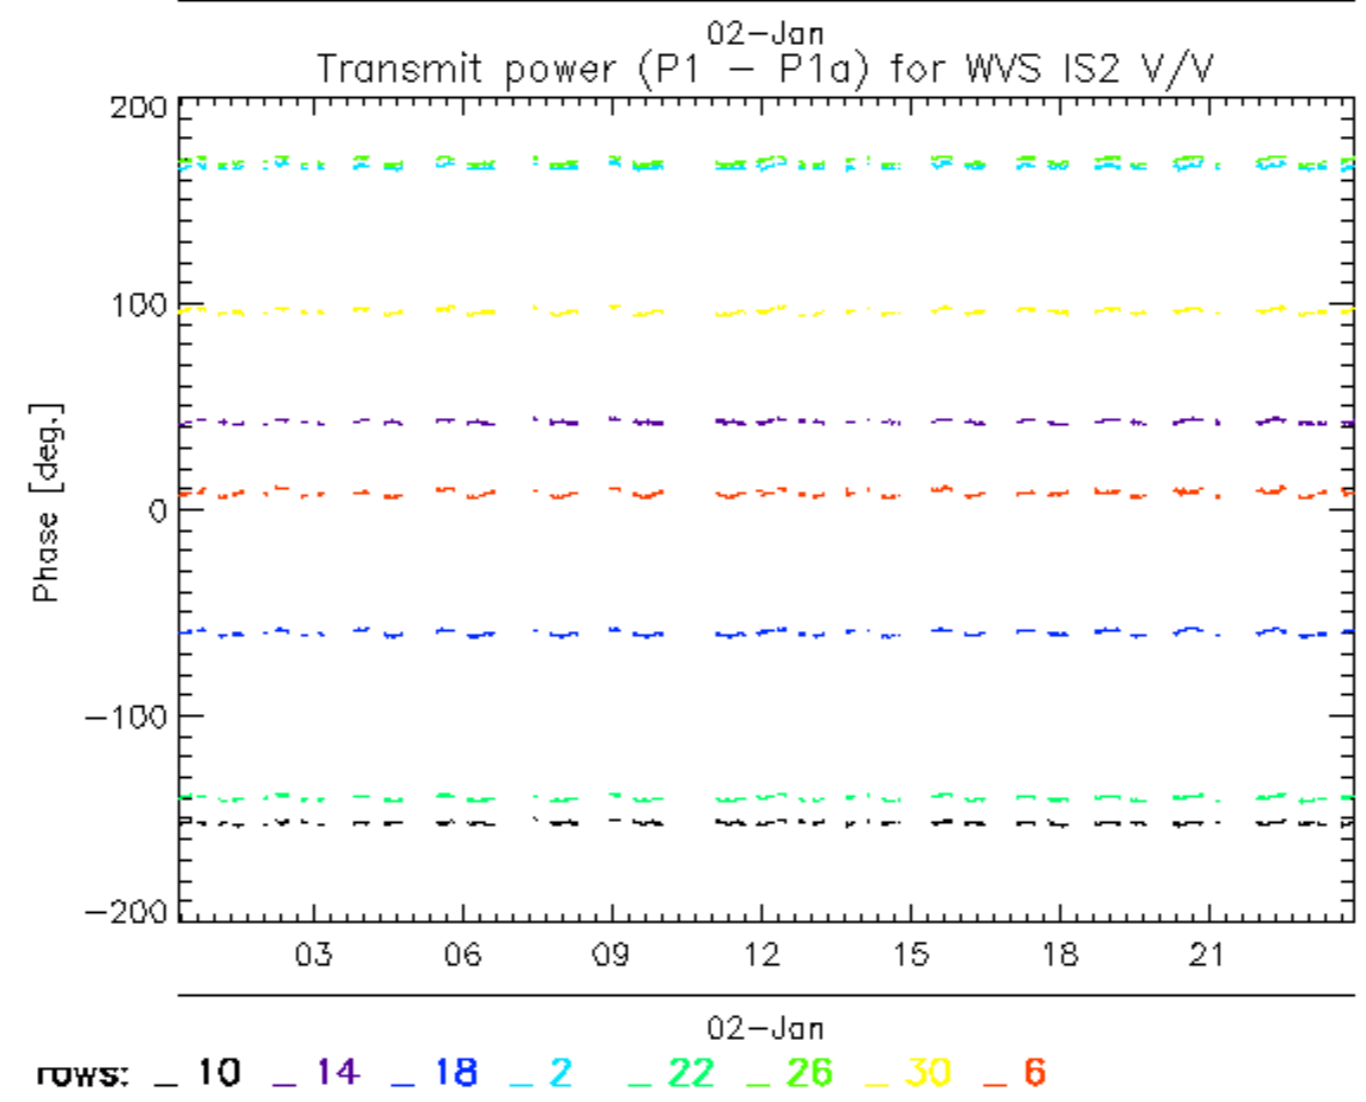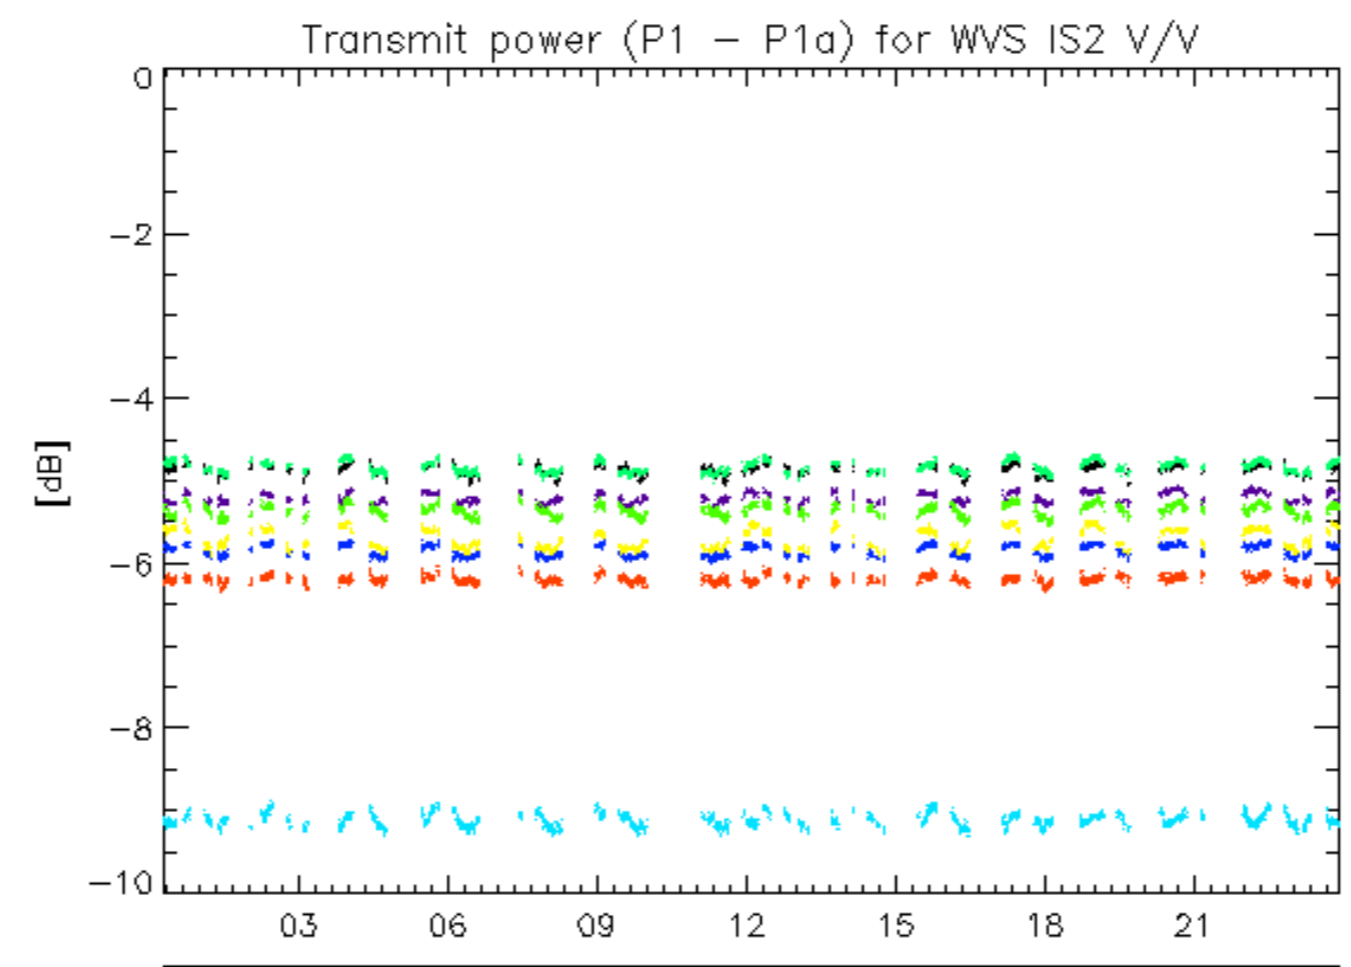


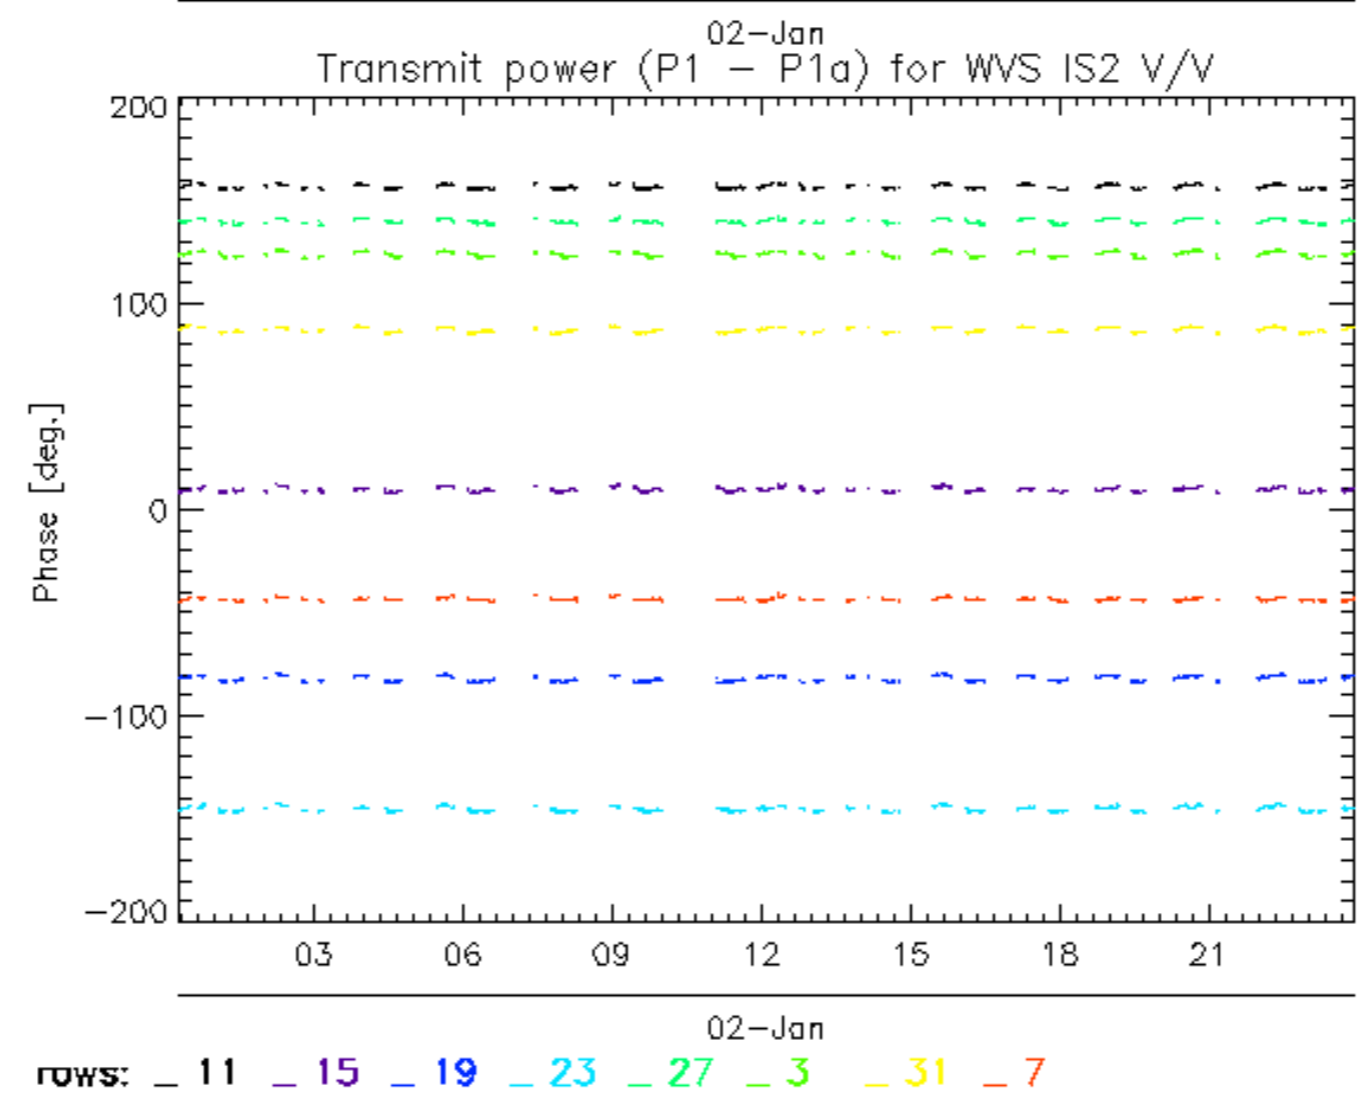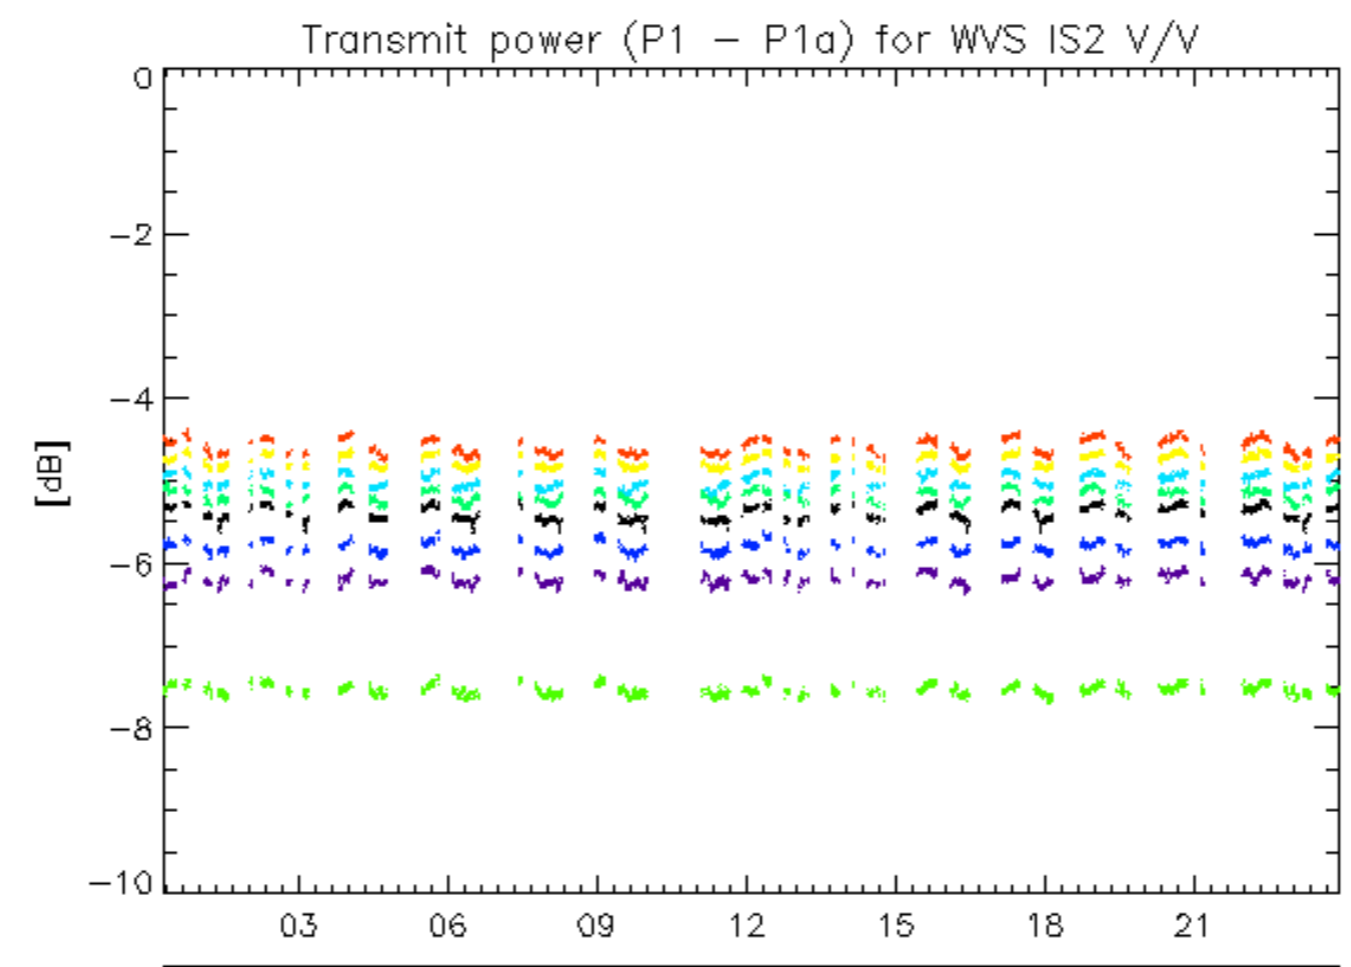


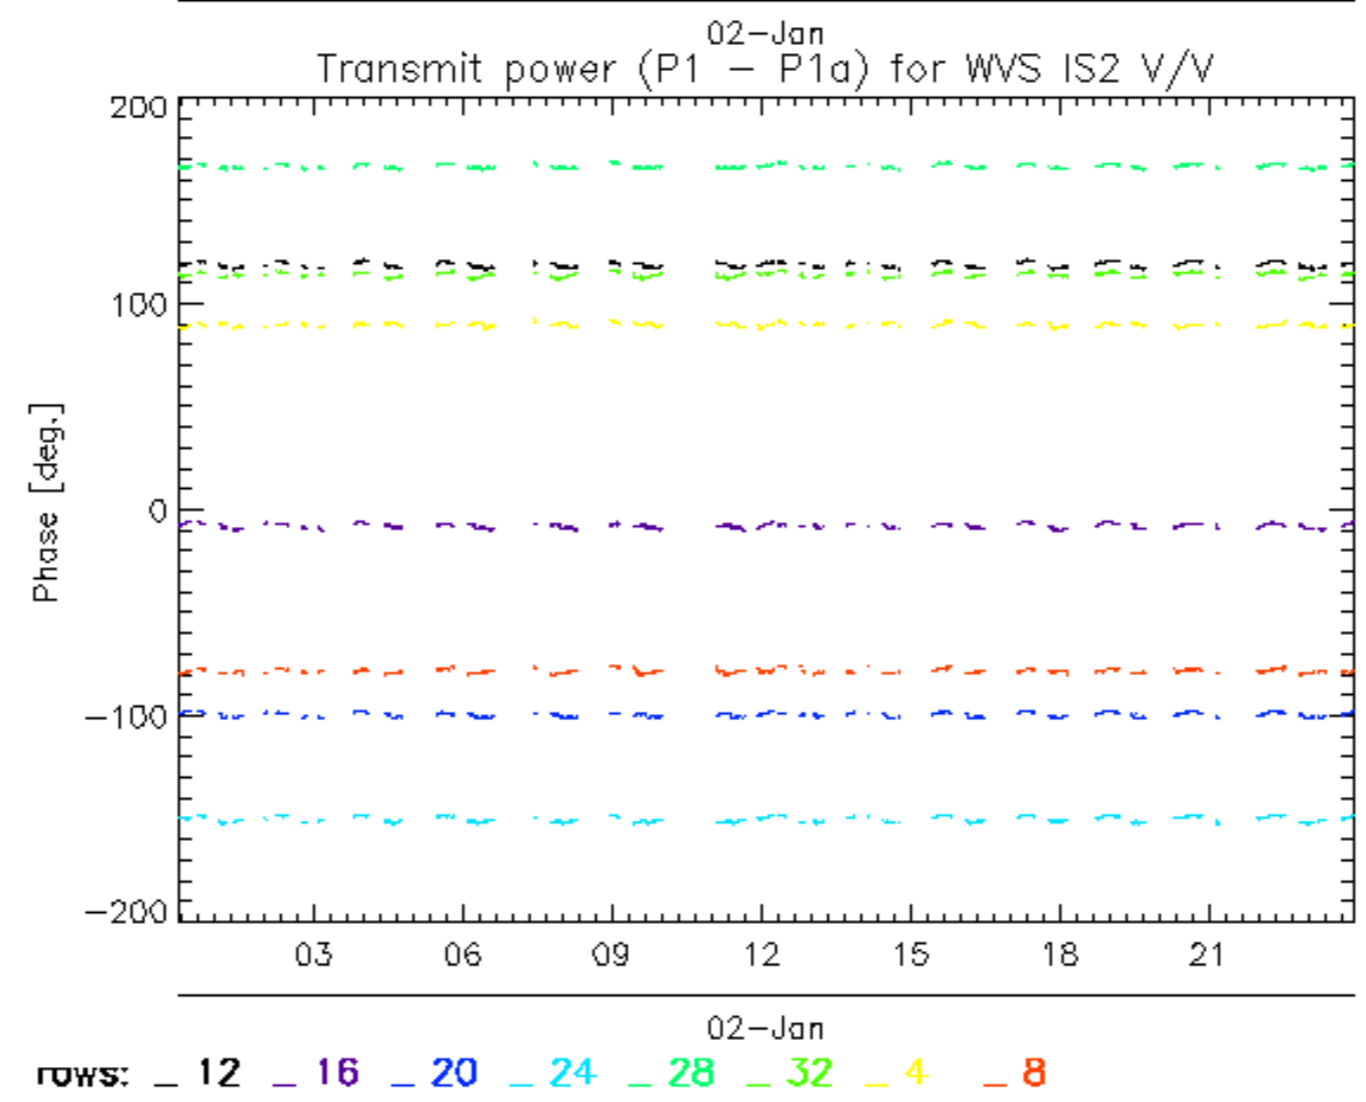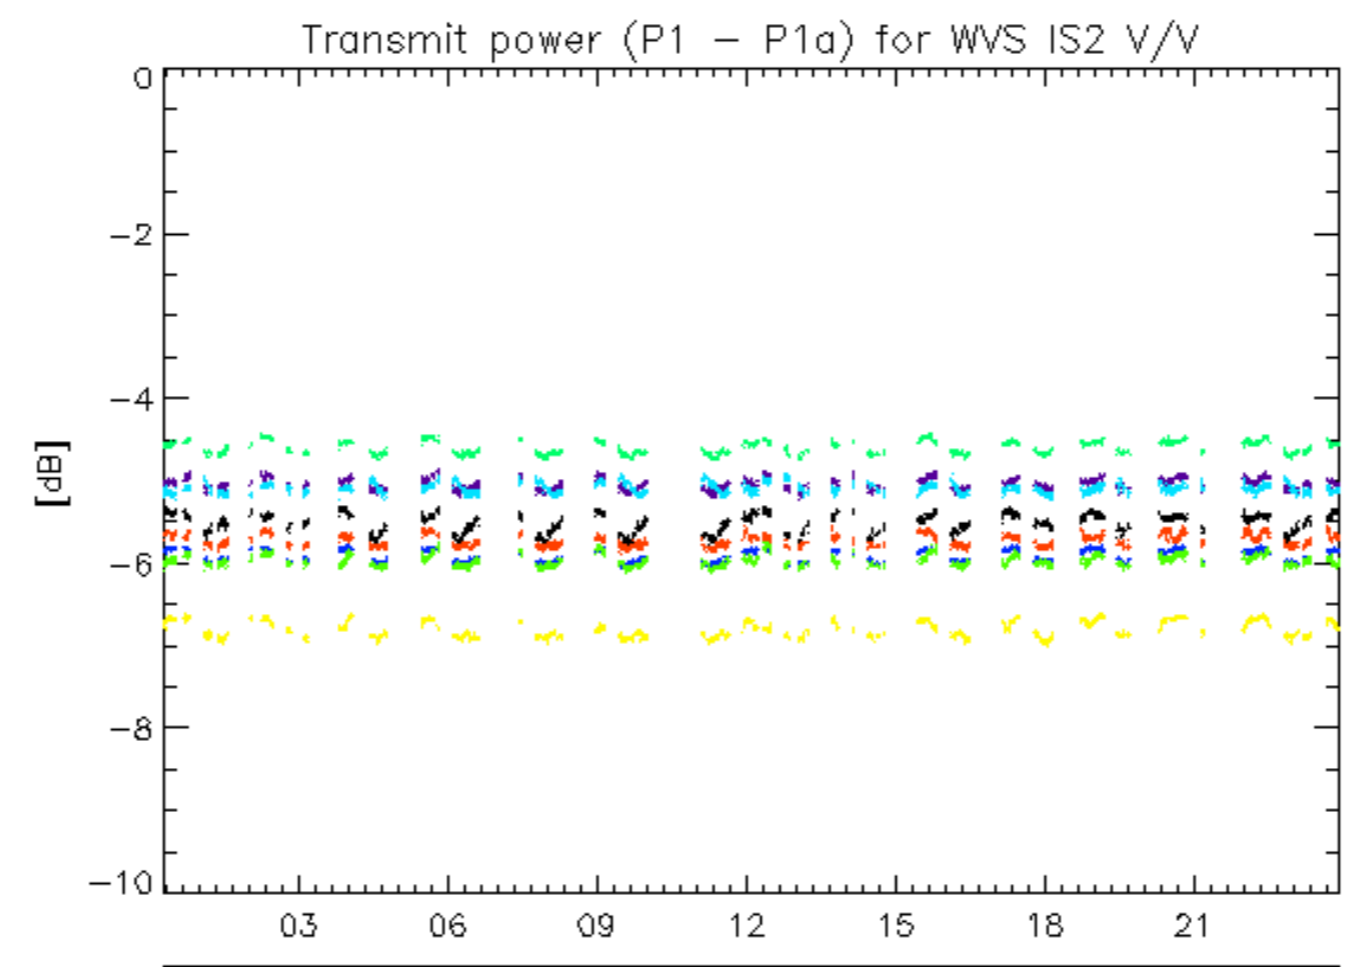

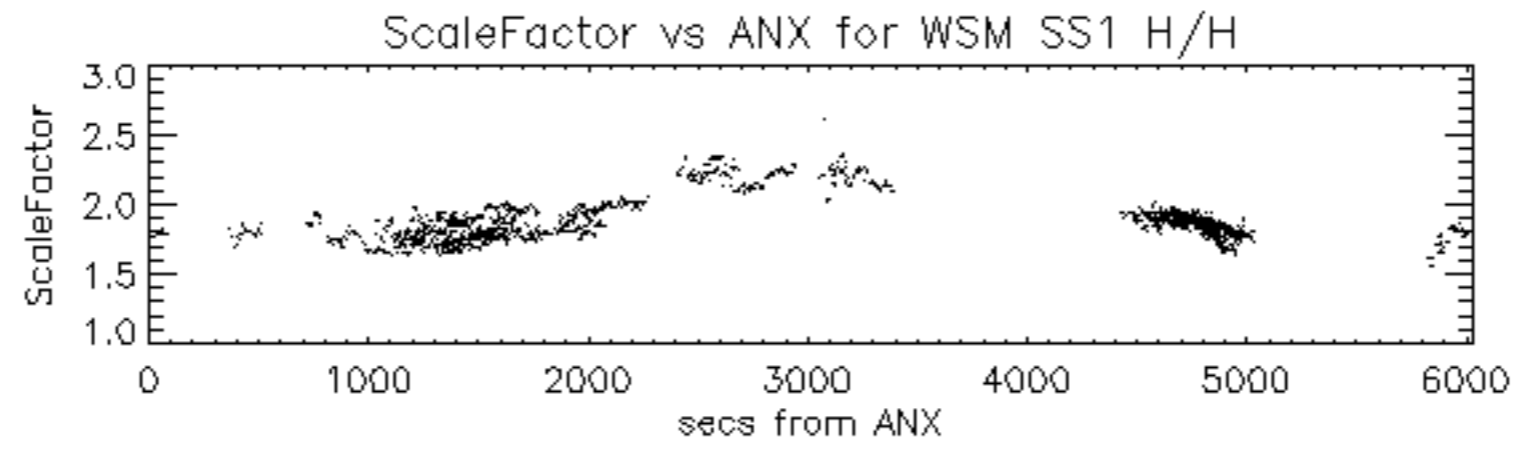

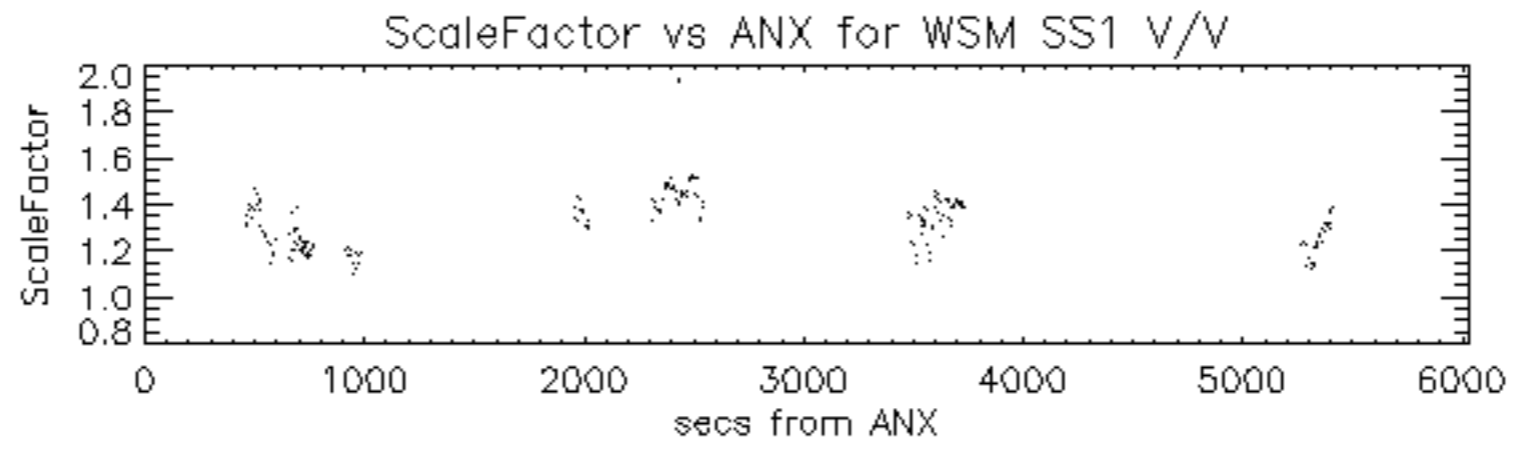

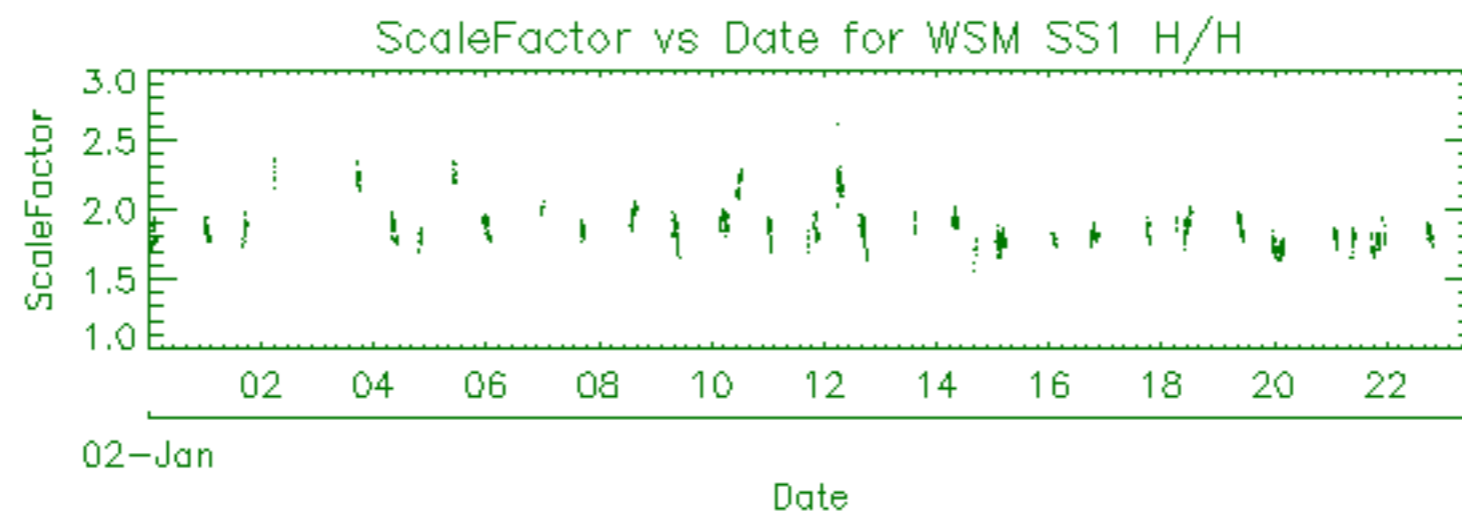

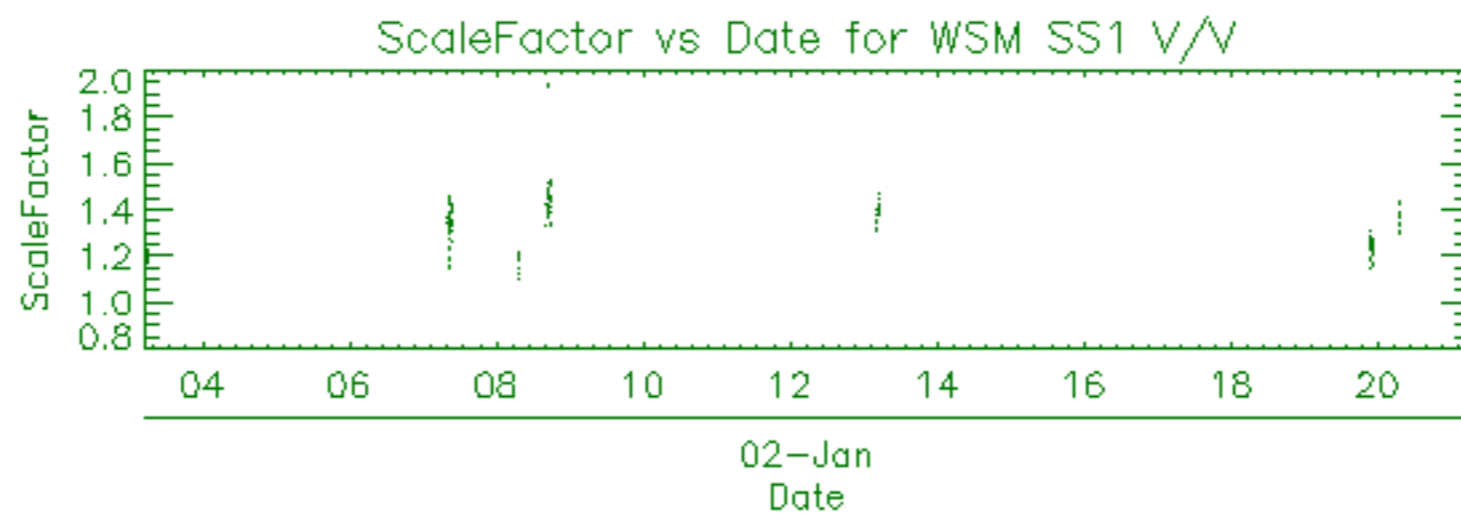

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_APM_1PNPDE20120102_020426_000000863110_00161_51468_5614.N1						IS2	H/H	110	51468	161	5.04
ASA_APM_1PNPDE20120102_020650_000000433110_00161_51468_5613.N1						IS2	H/H	110	51468	161	5.04
ASA_APM_1PNPDE20120102_021050_000000433110_00161_51468_5615.N1						IS1	V/H	110	51468	161	5.04
ASA_APM_1PNPDE20120102_021201_000000443110_00161_51468_5616.N1						IS4	V/H	110	51468	161	5.04
ASA_APM_1PNPDE20120102_044703_000000433110_00163_51470_5671.N1						IS1	V/H	110	51470	163	5.04
ASA_APM_1PNPDE20120102_144659_000000733110_00169_51476_5837.N1						IS6	H/H	110	51476	169	5.04

Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_GM1_1PNPDE20120102_000047_000001323110_00160_51467_5574.N1						SS1	H/H	110	51467	160	5.04
ASA_GM1_1PNPDE20120102_000746_000005313110_00160_51467_5580.N1						SS1	H/H	110	51467	160	5.04
ASA_GM1_1PNPDE20120102_003217_000001083110_00160_51467_5579.N1						SS1	H/H	110	51467	160	5.04
ASA_GM1_1PNPDE20120102_003504_000003383110_00160_51467_5577.N1						SS1	H/H	110	51467	160	5.04
ASA_GM1_1PNPDE20120102_004831_000006713110_00160_51467_5584.N1						SS1	H/H	110	51467	160	5.04
ASA_GM1_1PNPDE20120102_011514_000003623110_00160_51467_5608.N1						SS1	H/H	110	51467	160	5.04
ASA_GM1_1PNPDE20120102_013429_000003683110_00161_51468_5609.N1						SS1	H/H	110	51468	161	5.04
ASA_GM1_1PNPDE20120102_014515_000009363110_00161_51468_5612.N1						SS1	H/H	110	51468	161	5.04
ASA_GM1_1PNPDE20120102_020246_000009963110_00161_51468_5622.N1						SS1	H/H	110	51468	161	5.04
ASA_GM1_1PNPDE20120102_020752_000001753110_00161_51468_5621.N1						SS1	H/H	110	51468	161	5.04
ASA_GM1_1PNPDE20120102_022845_000009613110_00161_51468_5618.N1						SS1	H/H	110	51468	161	5.04
ASA_GM1_1PNPDE20120102_025219_000003983110_00161_51468_5617.N1						SS1	H/H	110	51468	161	5.04
ASA_GM1_1PNPDE20120102_030022_000002713110_00161_51468_5630.N1						SS1	H/H	110	51468	161	5.04
ASA_GM1_1PNPDE20120102_031058_000001143110_00162_51469_5629.N1						SS1	H/H	110	51469	162	5.04
ASA_GM1_1PNPDE20120102_031506_000016013110_00162_51469_5624.N1						SS1	H/H	110	51469	162	5.04
ASA_GM1_1PNPDE20120102_034608_000000843110_00162_51469_5633.N1						SS1	H/H	110	51469	162	5.04
ASA_GM1_1PNPDE20120102_040858_000005253110_00162_51469_5669.N1						SS1	H/H	110	51469	162	5.04
ASA_GM1_1PNPDE20120102_045102_000017583110_00163_51470_5678.N1						SS1	H/H	110	51470	163	5.04
ASA_GM1_1PNPDE20120102_054914_000004593110_00163_51470_5706.N1						SS1	H/H	110	51470	163	5.04
ASA_GM1_1PNPDE20120102_060333_000009963110_00163_51470_5709.N1						SS1	H/H	110	51470	163	5.04
ASA_GM1_1PNPDE20120102_063710_000009433110_00164_51471_5710.N1						SS1	H/H	110	51471	164	5.04
ASA_GM1_1PNPDE20120102_065737_000000723110_00164_51471_5716.N1						SS1	H/H	110	51471	164	5.04
ASA_GM1_1PNPDE20120102_070322_000007433110_00164_51471_5715.N1						SS1	H/H	110	51471	164	5.04
ASA_GM1_1PNPDE20120102_071745_000001443110_00164_51471_5714.N1						SS1	H/H	110	51471	164	5.04
ASA_GM1_1PNPDK20120102_072927_000006163110_00164_51471_1246.N1						SS1	H/H	110	51471	164	5.04
ASA_GM1_1PNPDK20120102_081924_000007073110_00165_51472_1248.N1						SS1	H/H	110	51472	165	5.04
ASA_GM1_1PNPDK20120102_082959_000002173110_00165_51472_1274.N1						SS1	H/H	110	51472	165	5.04
ASA_GM1_1PNPDK20120102_084518_000007493110_00165_51472_1275.N1						SS1	H/H	110	51472	165	5.04
ASA_GM1_1PNPDK20120102_090940_000005433110_00165_51472_1277.N1						SS1	H/H	110	51472	165	5.04
ASA_GM1_1PNPDK20120102_095955_000005553110_00166_51473_1279.N1						SS1	H/H	110	51473	166	5.04
ASA_GM1_1PNPDK20120102_102408_000001693110_00166_51473_1305.N1						SS1	H/H	110	51473	166	5.04
ASA_GM1_1PNPDK20120102_104954_000005433110_00166_51473_1307.N1						SS1	H/H	110	51473	166	5.04
ASA_GM1_1PNPDK20120102_110441_000000663110_00166_51473_1311.N1						SS1	H/H	110	51473	166	5.04
ASA_GM1_1PNPDK20120102_113930_000002173110_00167_51474_1310.N1						SS1	H/H	110	51474	167	5.04
ASA_GM1_1PNPDK20120102_114425_000002713110_00167_51474_1312.N1						SS1	H/H	110	51474	167	5.04
ASA_GM1_1PNPDK20120102_123011_000004833110_00167_51474_1337.N1						SS1	H/H	110	51474	167	5.04
ASA_GM1_1PNPDK20120102_125339_000005373110_00167_51474_1340.N1						SS1	H/H	110	51474	167	5.04
ASA_GM1_1PNPDK20120102_131429_000009123110_00168_51475_1342.N1						SS1	H/H	110	51475	168	5.04
ASA_GM1_1PNPDK20120102_132829_000004343110_00168_51475_1359.N1						SS1	H/H	110	51475	168	5.04
ASA_GM1_1PNPDK20120102_135114_000006893110_00168_51475_1360.N1						SS1	H/H	110	51475	168	5.04
ASA_GM1_1PNPDK20120102_140247_000003263110_00168_51475_1362.N1						SS1	H/H	110	51475	168	5.04
ASA_GM1_1PNPDK20120102_141021_000003983110_00168_51475_1363.N1						SS1	H/H	110	51475	168	5.04
ASA_GM1_1PNPDK20120102_142214_000002473110_00168_51475_1364.N1						SS1	H/H	110	51475	168	5.04
ASA_GM1_1PNPDK20120102_143342_000002413110_00168_51475_1366.N1						SS1	H/H	110	51475	168	5.04
ASA_GM1_1PNPDK20120102_144150_000001813110_00168_51475_1368.N1						SS1	H/H	110	51475	168	5.04
ASA_GM1_1PNPDK20120102_144920_000008583110_00169_51476_1372.N1						SS1	H/H	110	51476	169	5.04
ASA_GM1_1PNPDK20120102_151335_000000843110_00169_51476_1399.N1						SS1	H/H	110	51476	169	5.04
ASA_GM1_1PNPDK20120102_151736_000001503110_00169_51476_1398.N1						SS1	H/H	110	51476	169	5.04
ASA_GM1_1PNPDK20120102_152224_000002593110_00169_51476_1397.N1						SS1	H/H	110	51476	169	5.04
ASA_GM1_1PNPDK20120102_152931_000000903110_00169_51476_1400.N1						SS1	H/H	110	51476	169	5.04
ASA_GM1_1PNPDK20120102_155153_000006893110_00169_51476_1402.N1						SS1	H/H	110	51476	169	5.04
ASA_GM1_1PNPDK20120102_162842_000009063110_00170_51477_1403.N1						SS1	H/H	110	51477	170	5.04
ASA_GM1_1PNPDK20120102_165219_000006283110_00170_51477_1419.N1						SS1	H/H	110	51477	170	5.04
ASA_GM1_1PNPDK20120102_170454_000002233110_00170_51477_1420.N1						SS1	H/H	110	51477	170	5.04
ASA_GM1_1PNPDK20120102_173207_000007013110_00170_51477_1422.N1						SS1	H/H	110	51477	170	5.04
ASA_GM1_1PNPDK20120102_181040_000003083110_00171_51478_1423.N1						SS1	H/H	110	51478	171	5.04
ASA_GM1_1PNPDK20120102_181723_000003023110_00171_51478_1425.N1						SS1	H/H	110	51478	171	5.04
ASA_GM1_1PNPDK20120102_182105_000001503110_00171_51478_1451.N1						SS1	H/H	110	51478	171	5.04
ASA_GM1_1PNPDK20120102_183205_000001753110_00171_51478_1452.N1						SS1	H/H	110	51478	171	5.04
ASA_GM1_1PNPDK20120102_191105_000006223110_00171_51478_1456.N1						SS1	H/H	110	51478	171	5.04
ASA_GM1_1PNPDK20120102_193641_000001633110_00171_51478_1457.N1						SS1	H/H	110	51478	171	5.04
ASA_GM1_1PNPDK20120102_194229_000006223110_00171_51478_1459.N1						SS1	H/H	110	51478	171	5.04
ASA_GM1_1PNPDE20120102_201057_000003443110_00172_51479_5863.N1						SS1	H/H	110	51479	172	5.04
ASA_GM1_1PNPDE20120102_205119_000007733110_00172_51479_5865.N1						SS1	H/H	110	51479	172	5.04
ASA_GM1_1PNPDE20120102_211447_000004343110_00172_51479_5884.N1						SS1	H/H	110	51479	172	5.04
ASA_GM1_1PNPDE20120102_212615_000005013110_00173_51480_5886.N1						SS1	H/H	110	51480	173	5.04
ASA_GM1_1PNPDE20120102_213642_000001083110_00173_51480_5885.N1						SS1	H/H	110	51480	173	5.04


ASA_GM1_1PNPDE20120102_213922_00000843110_00173_51480_5889.N1	SS1	H/H	110	51480	173	5.04
ASA_GM1_1PNPDE20120102_215213_000002293110_00173_51480_5890.N1	SS1	H/H	110	51480	173	5.04
ASA_GM1_1PNPDE20120102_223132_000007133110_00173_51480_5893.N1	SS1	H/H	110	51480	173	5.04
ASA_GM1_1PNPDE20120102_230605_000003203110_00174_51481_5907.N1	SS1	H/H	110	51481	174	5.04
ASA_GM1_1PNPDE20120102_233208_000004163110_00174_51481_5910.N1	SS1	H/H	110	51481	174	5.04
ASA_GM1_1PNPDE20120102_235522_000001323110_00174_51481_5909.N1	SS1	H/H	110	51481	174	5.04
ASA_GM1_1PNPDE20120102_235900_000003083110_00174_51481_5912.N1	SS1	H/H	110	51481	174	5.04


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20120102_025133_000000383110_00161_51468_5626.N1						IS5	V/V	110	51468	161	5.04
ASA_IMM_1PNPDE20120102_025855_000000753110_00161_51468_5631.N1						IS7	V/V	110	51468	161	5.04
ASA_IMM_1PNPDE20120102_052021_000001583110_00163_51470_5665.N1						IS6	H/H	110	51470	163	5.04
ASA_IMM_1PNPDK20120102_065250_000002763110_00164_51471_1228.N1						IS6	H/H	110	51471	164	5.04
ASA_IMM_1PNPDE20120102_070127_000001053110_00164_51471_5703.N1						IS6	H/H	110	51471	164	5.04
ASA_IMM_1PNPDE20120102_071543_000001153110_00164_51471_5707.N1						IS2	V/V	110	51471	164	5.04
ASA_IMM_1PNPDE20120102_101747_000000393110_00166_51473_5767.N1						IS1	V/V	110	51473	166	5.04
ASA_IMM_1PNPDK20120102_101828_000000753110_00166_51473_1290.N1						IS6	H/H	110	51473	166	5.04
ASA_IMM_1PNPDE20120102_111118_000000523110_00166_51473_5788.N1						IS6	H/H	110	51473	166	5.04
ASA_IMM_1PNPDK20120102_125252_000000373110_00167_51474_1351.N1						IS6	H/H	110	51474	167	5.04
ASA_IMM_1PNPDE20120102_170320_000000823110_00170_51477_5845.N1						IS6	H/H	110	51477	170	5.04
ASA_IMM_1PNPDE20120102_183501_000002033110_00171_51478_5855.N1						IS6	H/H	110	51478	171	5.04
ASA_IMM_1PNPDE20120102_202831_000000433110_00172_51479_5876.N1						IS2	V/V	110	51479	172	5.04
ASA_IMM_1PNPDK20120102_213833_000000373110_00173_51480_1481.N1						IS7	H/H	110	51480	173	5.04
ASA_IMM_1PNPDE20120102_233901_000000443110_00174_51481_5924.N1						IS6	V/V	110	51481	174	5.04


Filename	Pol	Timestamp	count(Module)				
ASA_MS__0PNPDK20120102_155035_000000163110_00169_51476_0953.N1	H			2012-01-02	15:50:35	320	
ASA_MS__0PNPDK20120102_173049_000000163110_00170_51477_0954.N1	V			2012-01-02	17:30:49	320	


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WSM_1PNPDE20120101_235716_000002083110_00160_51467_5581.N1						SS1	H/H	110	51467	160	5.04
ASA_WSM_1PNPDE20120102_000308_000002753110_00160_51467_5590.N1						SS1	H/H	110	51467	160	5.04
ASA_WSM_1PNPDE20120102_005942_000003553110_00160_51467_5576.N1						SS1	H/H	110	51467	160	5.04
ASA_WSM_1PNPDE20120102_014039_000002693110_00161_51468_5611.N1						SS1	H/H	110	51468	161	5.04
ASA_WSM_1PNPDE20120102_021314_000000923110_00161_51468_5627.N1						SS1	H/H	110	51468	161	5.04
ASA_WSM_1PNPDK20120102_031300_000001223110_00162_51469_1203.N1						SS1	V/V	110	51469	162	5.04
ASA_WSM_1PNPDE20120102_034152_000002513110_00162_51469_5606.N1						SS1	H/H	110	51469	162	5.04
ASA_WSM_1PNPDE20120102_041749_000003923110_00162_51469_5667.N1						SS1	H/H	110	51469	162	5.04
ASA_WSM_1PNPDE20120102_044811_000001653110_00163_51470_5670.N1						SS1	H/H	110	51470	163	5.04
ASA_WSM_1PNPDE20120102_052327_000002203110_00163_51470_5666.N1						SS1	H/H	110	51470	163	5.04
ASA_WSM_1PNPDE20120102_055654_000003923110_00163_51470_5722.N1						SS1	H/H	110	51470	163	5.04
ASA_WSM_1PNPDE20120102_065901_000000923110_00164_51471_5702.N1						SS1	H/H	110	51471	164	5.04
ASA_WSM_1PNPDE20120102_072014_000002693110_00164_51471_5711.N1						SS1	V/V	110	51471	164	5.04
ASA_WSM_1PNPDK20120102_073946_000002753110_00164_51471_1255.N1						SS1	H/H	110	51471	164	5.04
ASA_WSM_1PNPDK20120102_081748_000000923110_00165_51472_1256.N1						SS1	V/V	110	51472	165	5.04
ASA_WSM_1PNPDE20120102_083342_000002753110_00165_51472_5745.N1						SS1	H/H	110	51472	165	5.04
ASA_WSM_1PNPDK20120102_083629_000002143110_00165_51472_1258.N1						SS1	H/H	110	51472	165	5.04
ASA_WSM_1PNPDE20120102_084058_000002513110_00165_51472_5746.N1						SS1	V/V	110	51472	165	5.04
ASA_WSM_1PNPDK20120102_091844_000003923110_00165_51472_1287.N1						SS1	H/H	110	51472	165	5.04
ASA_WSM_1PNPDE20120102_100914_000002143110_00166_51473_5765.N1						SS1	H/H	110	51473	166	5.04
ASA_WSM_1PNPDE20120102_101403_000002203110_00166_51473_5766.N1						SS1	H/H	110	51473	166	5.04
ASA_WSM_1PNPDK20120102_101403_000002203110_00166_51473_1288.N1						SS1	H/H	110	51473	166	5.04
ASA_WSM_1PNPDE20120102_102702_000003123110_00166_51473_5768.N1						SS1	H/H	110	51473	166	5.04
ASA_WSM_1PNPDE20120102_105904_000003303110_00166_51473_5787.N1						SS1	H/H	110	51473	166	5.04
ASA_WSM_1PNPDE20120102_114312_000000733110_00167_51474_5789.N1						SS1	H/H	110	51474	167	5.04
ASA_WSM_1PNPDK20120102_114858_000003613110_00167_51474_1321.N1						SS1	H/H	110	51474	167	5.04
ASA_WSM_1PNPDE20120102_121352_000003613110_00167_51474_5798.N1						SS1	H/H	110	51474	167	5.04
ASA_WSM_1PNPDK20120102_123820_000004533110_00167_51474_1350.N1						SS1	H/H	110	51474	167	5.04
ASA_WSM_1PNPDK20120102_131049_000000923110_00168_51475_1352.N1						SS1	V/V	110	51475	168	5.04
ASA_WSM_1PNPDE20120102_133549_000001163110_00168_51475_5834.N1						SS1	H/H	110	51475	168	5.04
ASA_WSM_1PNPDE20120102_141704_000003063110_00168_51475_5836.N1						SS1	H/H	110	51475	168	5.04
ASA_WSM_1PNPDE20120102_144016_000000923110_00168_51475_5835.N1						SS1	H/H	110	51475	168	5.04
ASA_WSM_1PNPDK20120102_150339_000004343110_00169_51476_1383.N1						SS1	H/H	110	51476	169	5.04
ASA_WSM_1PNPDK20120102_151126_000001223110_00169_51476_1384.N1						SS1	H/H	110	51476	169	5.04
ASA_WSM_1PNPDE20120102_160323_000002143110_00169_51476_5833.N1						SS1	H/H	110	51476	169	5.04
ASA_WSM_1PNPDK20120102_164353_000002083110_00170_51477_1412.N1						SS1	H/H	110	51477	170	5.04
ASA_WSM_1PNPDE20120102_164646_000003303110_00170_51477_5844.N1						SS1	H/H	110	51477	170	5.04
ASA_WSM_1PNPDE20120102_174352_000001903110_00170_51477_5843.N1						SS1	H/H	110	51477	170	5.04
ASA_WSM_1PNPDE20120102_181548_000000923110_00171_51478_5846.N1						SS1	H/H	110	51478	171	5.04
ASA_WSM_1PNPDK20120102_182342_000002513110_00171_51478_1437.N1						SS1	H/H	110	51478	171	5.04
ASA_WSM_1PNPDE20120102_182723_000002813110_00171_51478_5847.N1						SS1	H/H	110	51478	171	5.04
ASA_WSM_1PNPDE20120102_192128_000003303110_00171_51478_5854.N1						SS1	H/H	110	51478	171	5.04
ASA_WSM_1PNPDE20120102_195257_000000923110_00172_51479_5856.N1						SS1	V/V	110	51479	172	5.04
ASA_WSM_1PNPDE20120102_195502_000001103110_00172_51479_5857.N1						SS1	V/V	110	51479	172	5.04
ASA_WSM_1PNPDK20120102_195740_000004163110_00172_51479_1467.N1						SS1	H/H	110	51479	172	5.04
ASA_WSM_1PNPDK20120102_200551_000002083110_00172_51479_1468.N1						SS1	H/H	110	51479	172	5.04
ASA_WSM_1PNPDE20120102_200653_000002393110_00172_51479_5875.N1						SS1	H/H	110	51479	172	5.04
ASA_WSM_1PNPDE20120102_201645_000000923110_00172_51479_5874.N1						SS1	V/V	110	51479	172	5.04
ASA_WSM_1PNPDE20120102_210414_000001903110_00172_51479_5871.N1						SS1	H/H	110	51479	172	5.04
ASA_WSM_1PNPDE20120102_211159_000001653110_00172_51479_5873.N1						SS1	V/V	110	51479	172	5.04
ASA_WSM_1PNPDE20120102_212206_000002513110_00172_51479_5877.N1						SS1	H/H	110	51479	172	5.04
ASA_WSM_1PNPDE20120102_214331_000005143110_00173_51480_5899.N1						SS1	H/H	110	51480	173	5.04
ASA_WSM_1PNPDE20120102_215608_000001533110_00173_51480_5900.N1						SS1	H/H	110	51480	173	5.04
ASA_WSM_1PNPDE20120102_224327_000003063110_00173_51480_5887.N1						SS1	H/H	110	51480	173	5.04
ASA_WSM_1PNPDK20120102_232151_000002453110_00174_51481_1489.N1						SS1	H/H	110	51481	174	5.04
ASA_WSM_1PNPDE20120102_232708_000003003110_00174_51481_5923.N1						SS1	H/H	110	51481	174	5.04




Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_WVS_1PNPDE20120102_001638_000008993110_00160_51467_5578.N1						IS2	V/V	110	51467	160	5.04
ASA_WVS_1PNPDE20120102_004047_000004203110_00160_51467_5582.N1						IS2	V/V	110	51467	160	5.04
ASA_WVS_1PNPDE20120102_010535_000003453110_00160_51467_5583.N1						IS2	V/V	110	51467	160	5.04
ASA_WVS_1PNPDE20120102_011035_000002393110_00160_51467_5625.N1						IS2	V/V	110	51467	160	5.04
ASA_WVS_1PNPDE20120102_012118_000007493110_00160_51467_5610.N1						IS2	V/V	110	51467	160	5.04
ASA_WVS_1PNPDE20120102_020051_000000743110_00161_51468_5620.N1						IS2	V/V	110	51468	161	5.04
ASA_WVS_1PNPDE20120102_021444_000007953110_00161_51468_5619.N1						IS2	V/V	110	51468	161	5.04
ASA_WVS_1PNPDE20120102_024448_000003003110_00161_51468_5628.N1						IS2	V/V	110	51468	161	5.04
ASA_WVS_1PNPDE20120102_030458_000003143110_00162_51469_5623.N1						IS2	V/V	110	51469	162	5.04
ASA_WVS_1PNPDE20120102_034740_000007643110_00162_51469_5632.N1						IS2	V/V	110	51469	162	5.04
ASA_WVS_1PNPDE20120102_040009_000002403110_00162_51469_5668.N1						IS2	V/V	110	51469	162	5.04
ASA_WVS_1PNPDE20120102_042453_000012293110_00162_51469_5672.N1						IS2	V/V	110	51469	162	5.04
ASA_WVS_1PNPDE20120102_052707_000010043110_00163_51470_5673.N1						IS2	V/V	110	51470	163	5.04
ASA_WVS_1PNPDE20120102_054336_000000153110_00163_51470_5704.N1						IS2	V/V	110	51470	163	5.04
ASA_WVS_1PNPDE20120102_054626_000001203110_00163_51470_5705.N1						IS2	V/V	110	51470	163	5.04
ASA_WVS_1PNPDE20120102_060516_000009743110_00163_51470_5708.N1						IS2	V/V	110	51470	163	5.04
ASA_WVS_1PNPDE20120102_062146_000008843110_00163_51470_5713.N1						IS2	V/V	110	51470	163	5.04
ASA_WVS_1PNPDK20120102_072445_000002403110_00164_51471_1245.N1						IS2	V/V	110	51471	164	5.04
ASA_WVS_1PNPDK20120102_074521_000019043110_00164_51471_1247.N1						IS2	V/V	110	51471	164	5.04
ASA_WVS_1PNPDK20120102_085747_000006753110_00165_51472_1276.N1						IS2	V/V	110	51472	165	5.04
ASA_WVS_1PNPDK20120102_092535_000020093110_00165_51472_1278.N1						IS2	V/V	110	51472	165	5.04
ASA_WVS_1PNPDK20120102_110557_000002553110_00166_51473_1309.N1						IS2	V/V	110	51473	166	5.04
ASA_WVS_1PNPDK20120102_111258_000015443110_00166_51473_1313.N1						IS2	V/V	110	51473	166	5.04
ASA_WVS_1PNPDK20120102_115524_000010643110_00167_51474_1335.N1						IS2	V/V	110	51474	167	5.04
ASA_WVS_1PNPDK20120102_121952_000005703110_00167_51474_1336.N1						IS2	V/V	110	51474	167	5.04
ASA_WVS_1PNPDK20120102_124602_000003303110_00167_51474_1338.N1						IS2	V/V	110	51474	167	5.04
ASA_WVS_1PNPDK20120102_130238_000004423110_00167_51474_1339.N1						IS2	V/V	110	51474	167	5.04
ASA_WVS_1PNPDK20120102_131254_000000453110_00168_51475_1341.N1						IS2	V/V	110	51475	168	5.04
ASA_WVS_1PNPDK20120102_134138_000005243110_00168_51475_1361.N1						IS2	V/V	110	51475	168	5.04
ASA_WVS_1PNPDK20120102_140814_000000903110_00168_51475_1365.N1						IS2	V/V	110	51475	168	5.04
ASA_WVS_1PNPDK20120102_142625_000003903110_00168_51475_1367.N1						IS2	V/V	110	51475	168	5.04
ASA_WVS_1PNPDK20120102_143745_000001043110_00168_51475_1369.N1						IS2	V/V	110	51475	168	5.04
ASA_WVS_1PNPDK20120102_144454_000000893110_00169_51476_1370.N1						IS2	V/V	110	51476	169	5.04
ASA_WVS_1PNPDK20120102_152643_000001193110_00169_51476_1396.N1						IS2	V/V	110	51476	169	5.04
ASA_WVS_1PNPDK20120102_153108_000011243110_00169_51476_1401.N1						IS2	V/V	110	51476	169	5.04
ASA_WVS_1PNPDK20120102_160653_000012593110_00169_51476_1404.N1						IS2	V/V	110	51476	169	5.04
ASA_WVS_1PNPDK20120102_170837_000012893110_00170_51477_1421.N1						IS2	V/V	110	51477	170	5.04
ASA_WVS_1PNPDK20120102_174707_000013643110_00170_51477_1424.N1						IS2	V/V	110	51477	170	5.04
ASA_WVS_1PNPDK20120102_184243_000016643110_00171_51478_1454.N1						IS2	V/V	110	51478	171	5.04
ASA_WVS_1PNPDK20120102_192659_000001503110_00171_51478_1453.N1						IS2	V/V	110	51478	171	5.04
ASA_WVS_1PNPDK20120102_193148_000002553110_00171_51478_1455.N1						IS2	V/V	110	51478	171	5.04
ASA_WVS_1PNPDK20120102_193928_000001343110_00171_51478_1458.N1						IS2	V/V	110	51478	171	5.04
ASA_WVS_1PNPDE20120102_201816_000005693110_00172_51479_5862.N1						IS2	V/V	110	51479	172	5.04
ASA_WVS_1PNPDE20120102_202922_000012743110_00172_51479_5864.N1						IS2	V/V	110	51479	172	5.04
ASA_WVS_1PNPDE20120102_210735_000002253110_00172_51479_5888.N1						IS2	V/V	110	51479	172	5.04
ASA_WVS_1PNPDE20120102_215838_000019343110_00173_51480_5891.N1						IS2	V/V	110	51480	173	5.04
ASA_WVS_1PNPDE20120102_224833_000002993110_00173_51480_5897.N1						IS2	V/V	110	51480	173	5.04
ASA_WVS_1PNPDE20120102_225233_000007643110_00173_51480_5906.N1						IS2	V/V	110	51480	173	5.04
ASA_WVS_1PNPDE20120102_224833_000002993110_00173_51480_5897.N1						IS1	V/V	110	51480	173	5.04
ASA_WVS_1PNPDE20120102_231129_000005843110_00174_51481_5908.N1						IS2	V/V	110	51481	174	5.04
ASA_WVS_1PNPDE20120102_233955_000008843110_00174_51481_5911.N1						IS2	V/V	110	51481	174	5.04



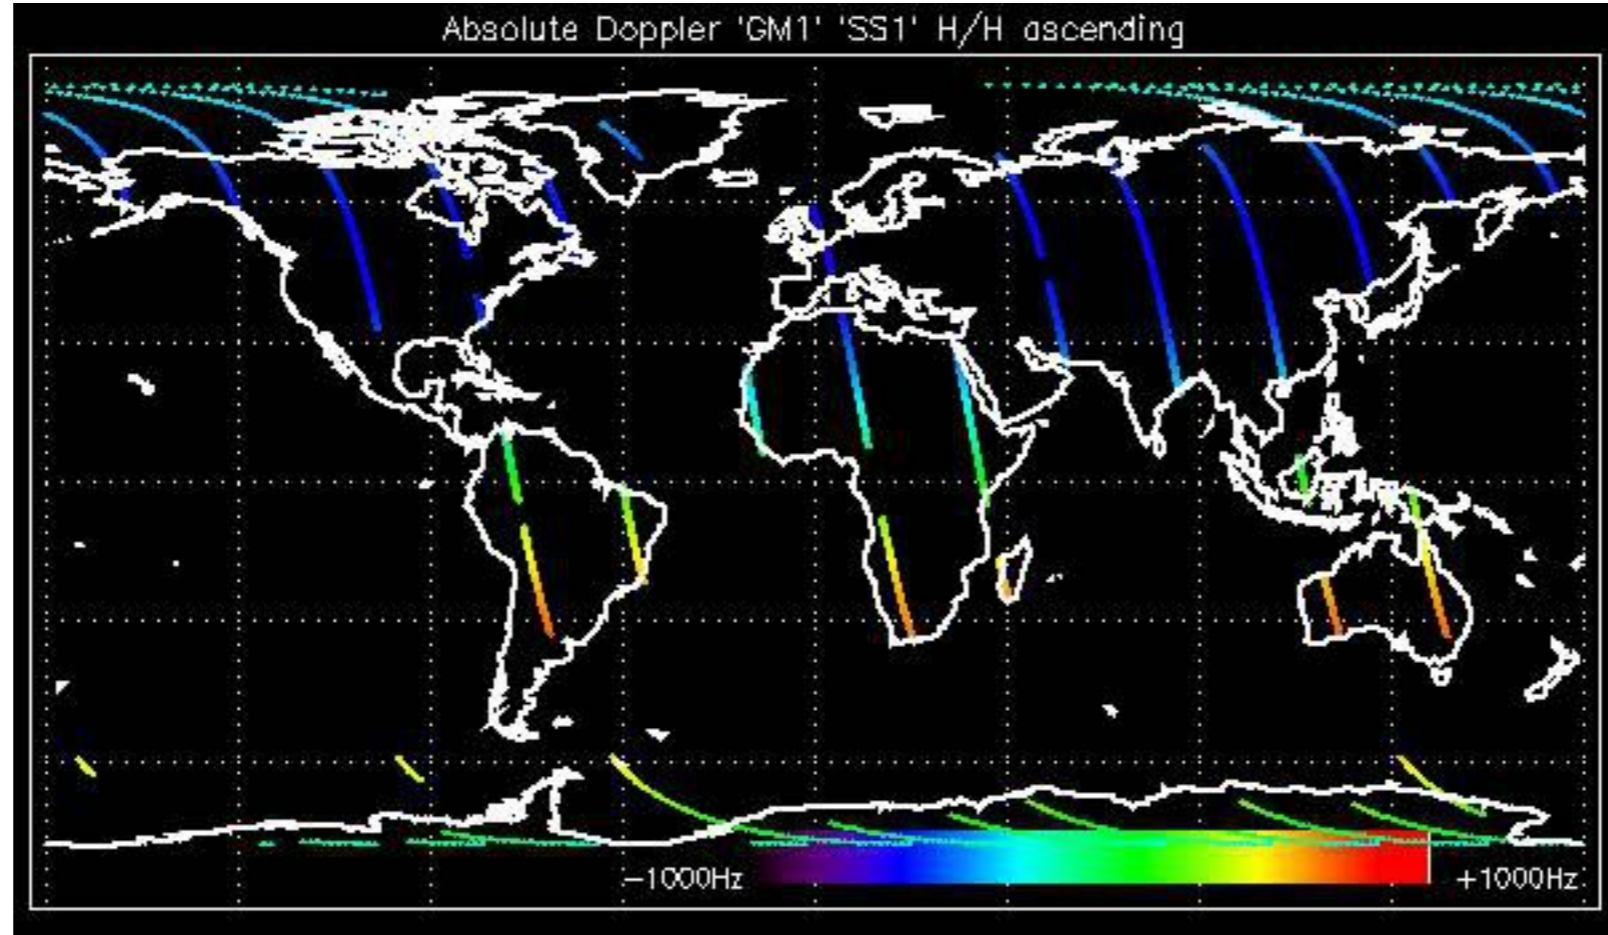


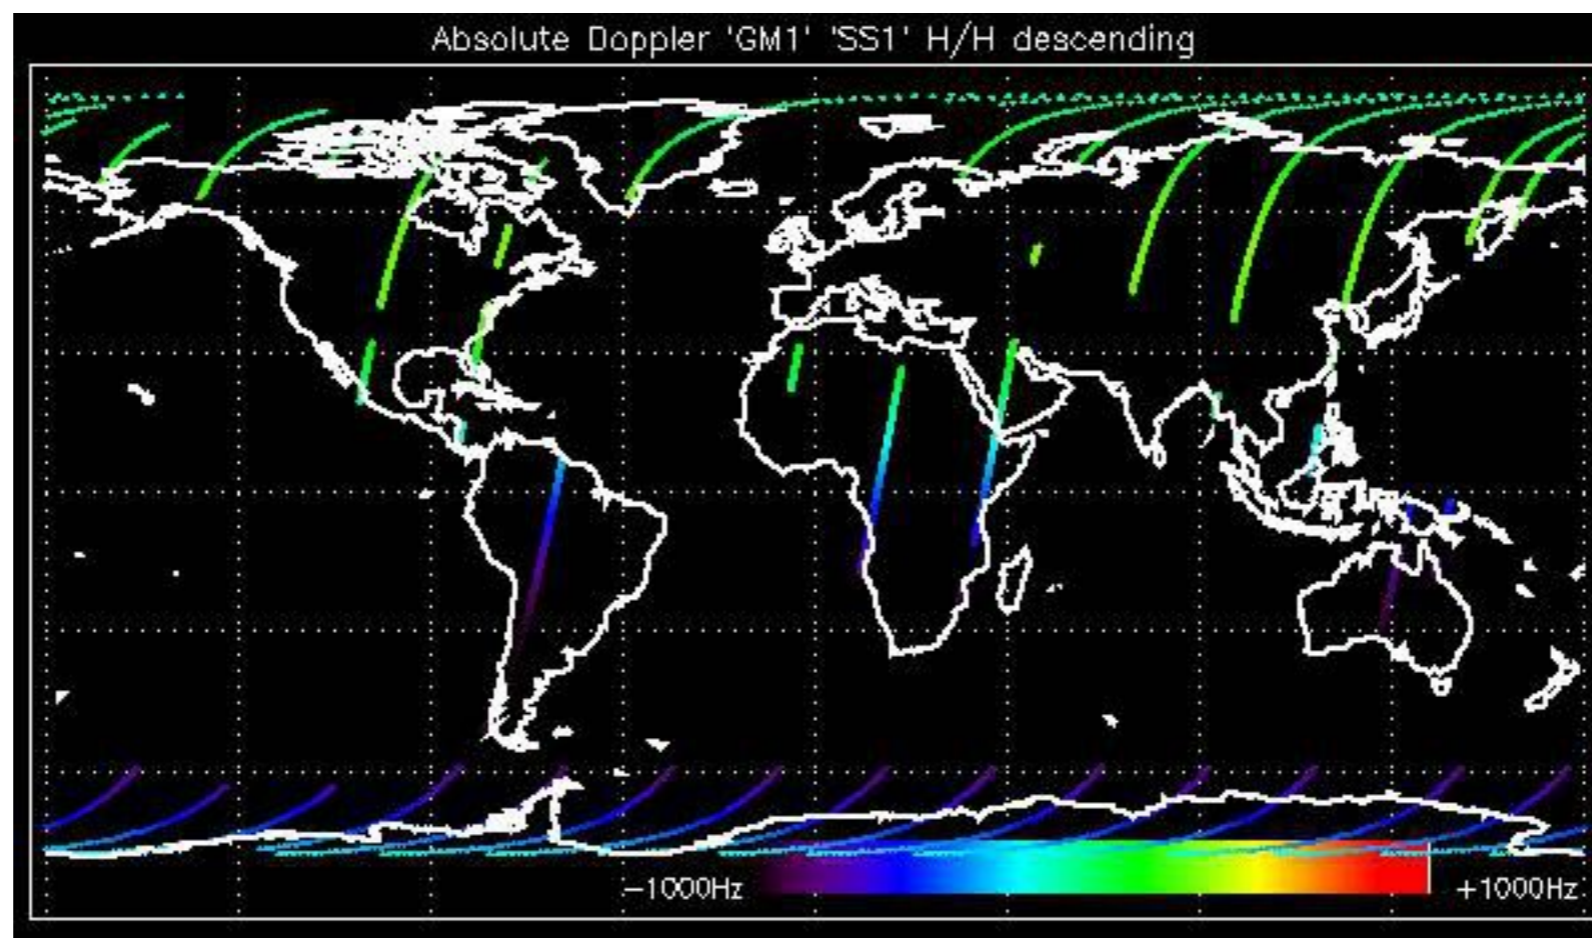


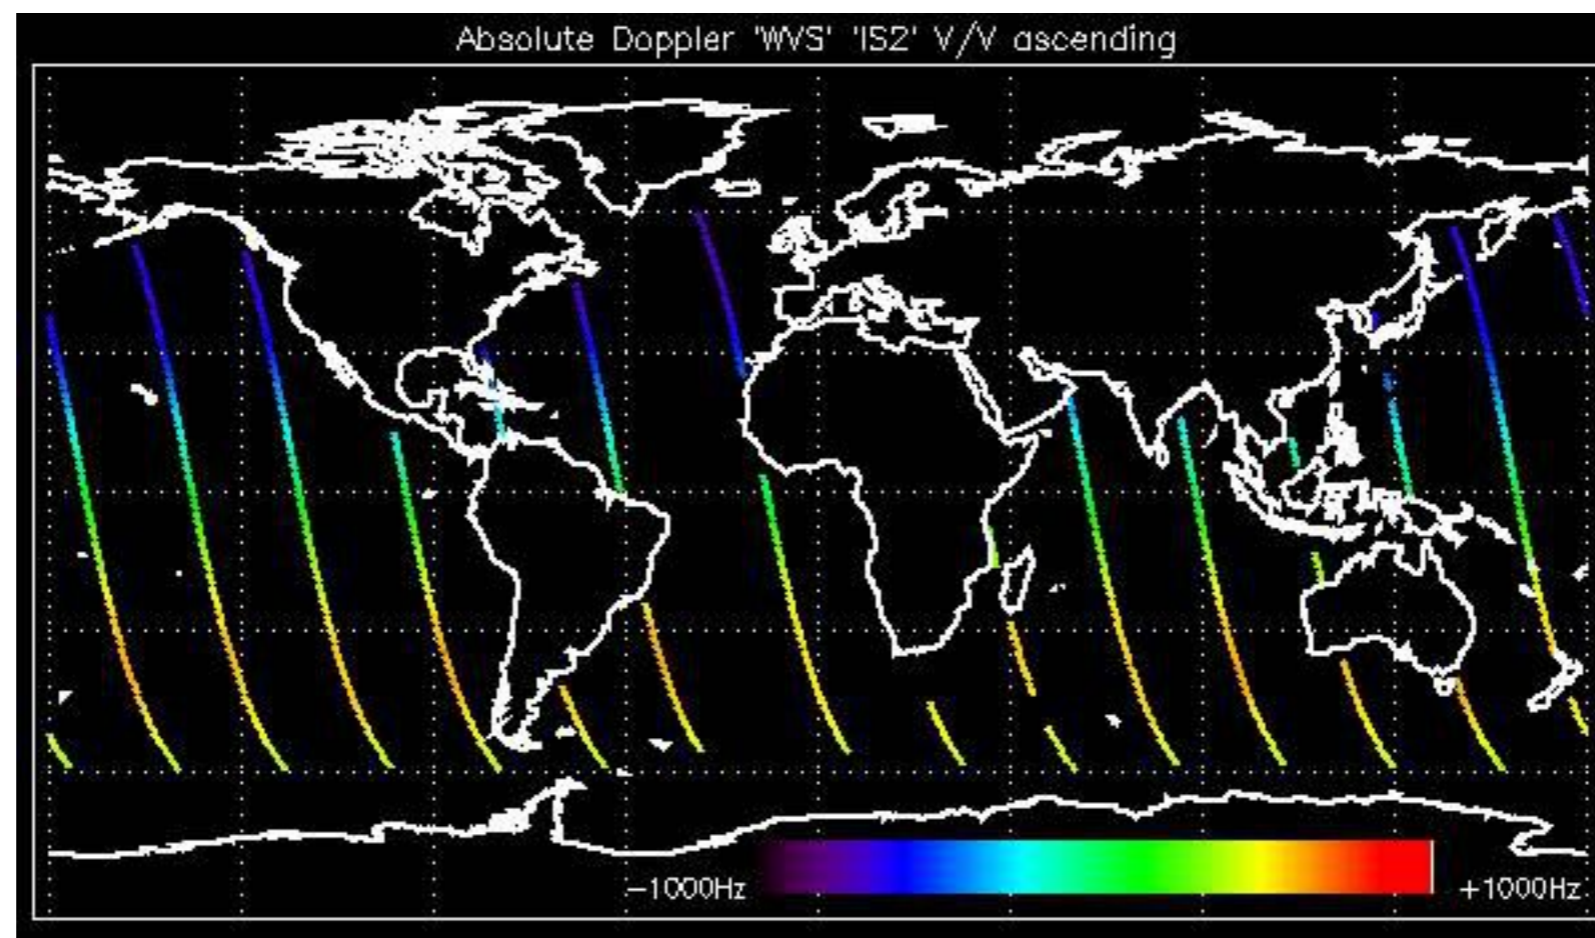


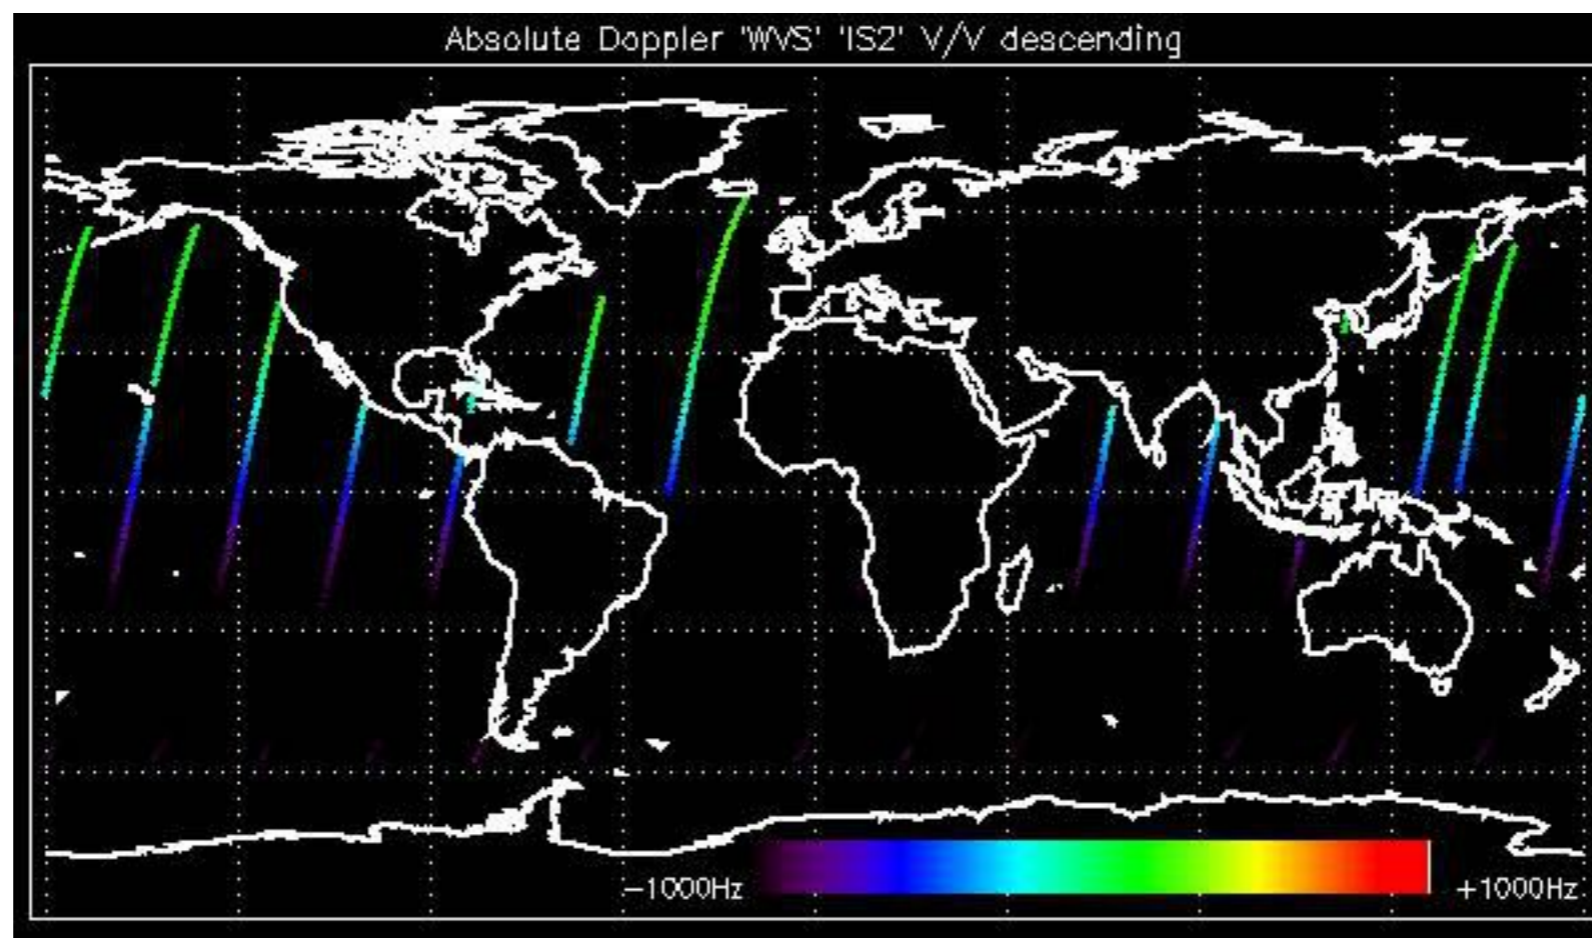


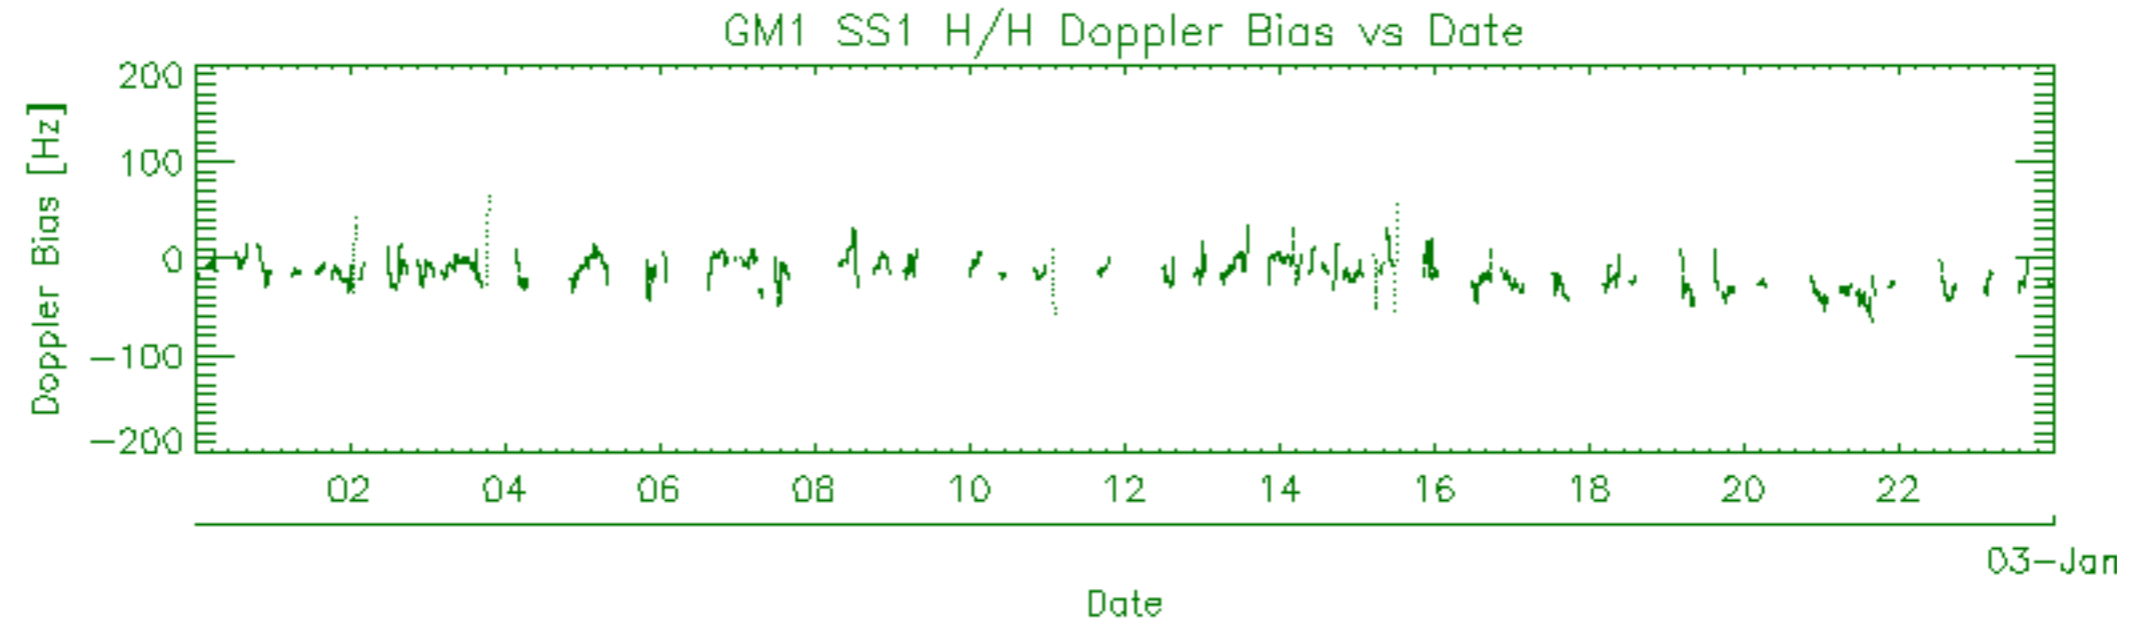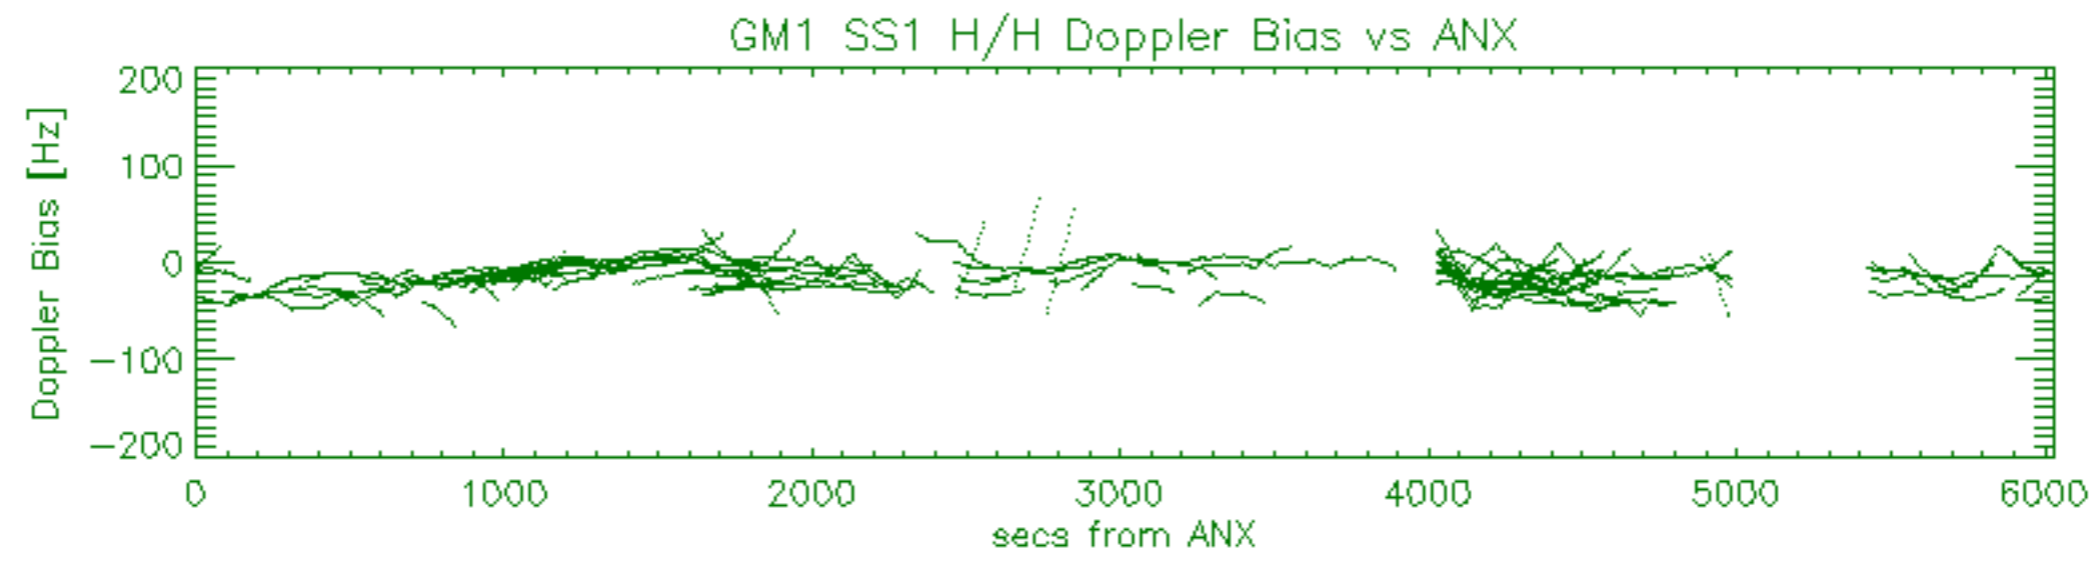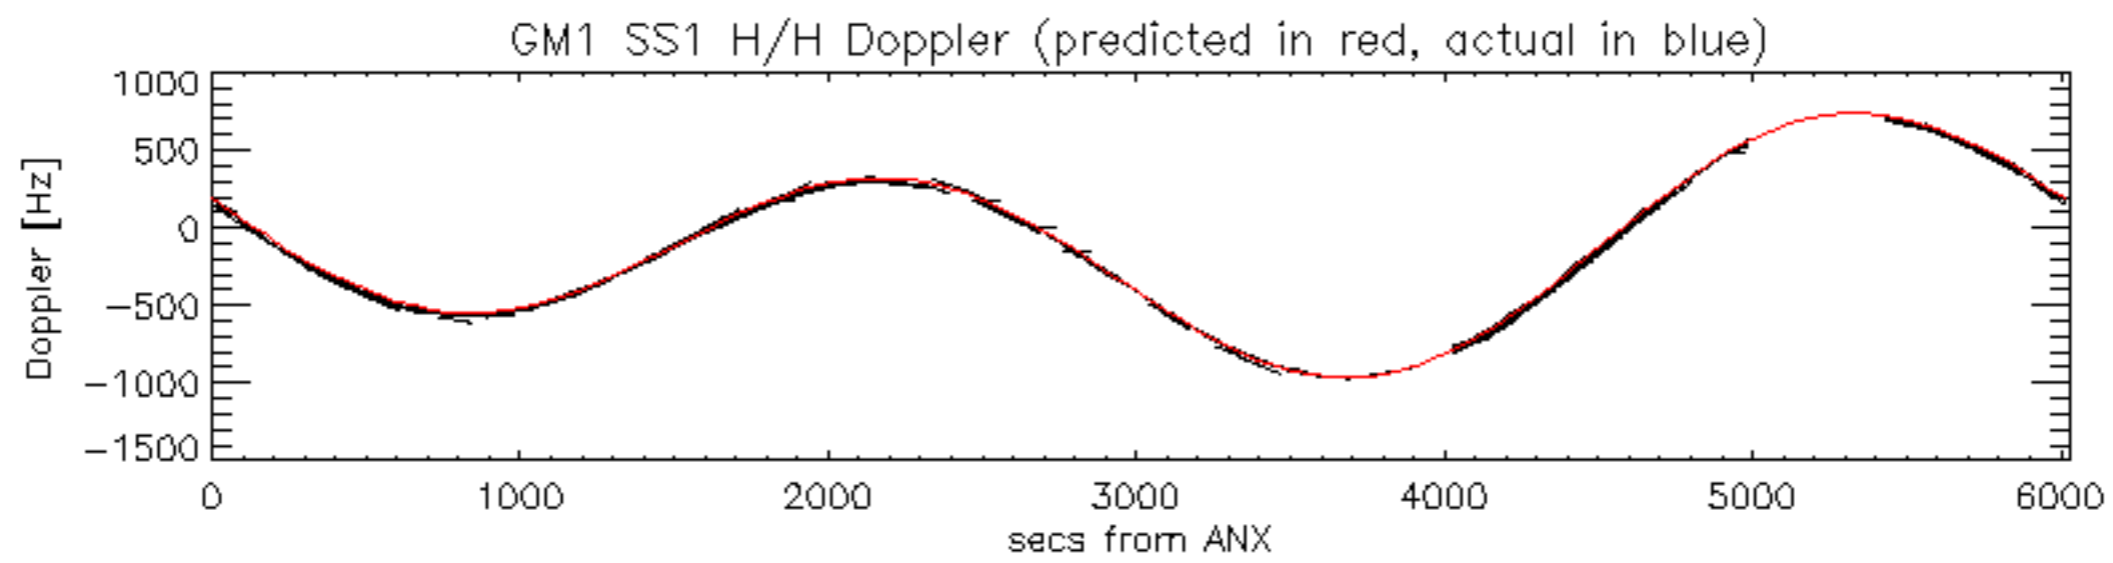



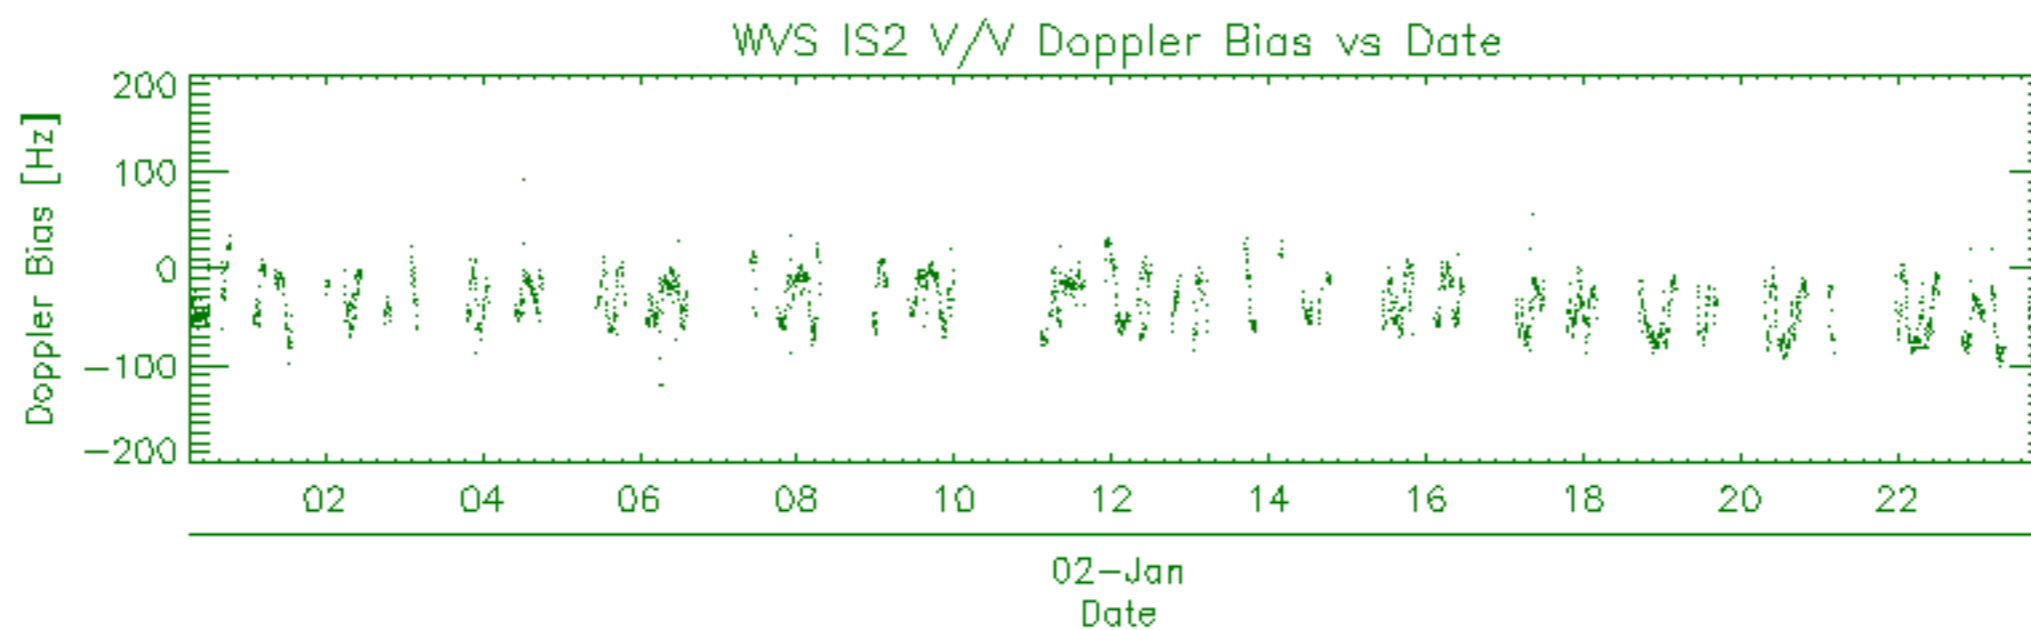
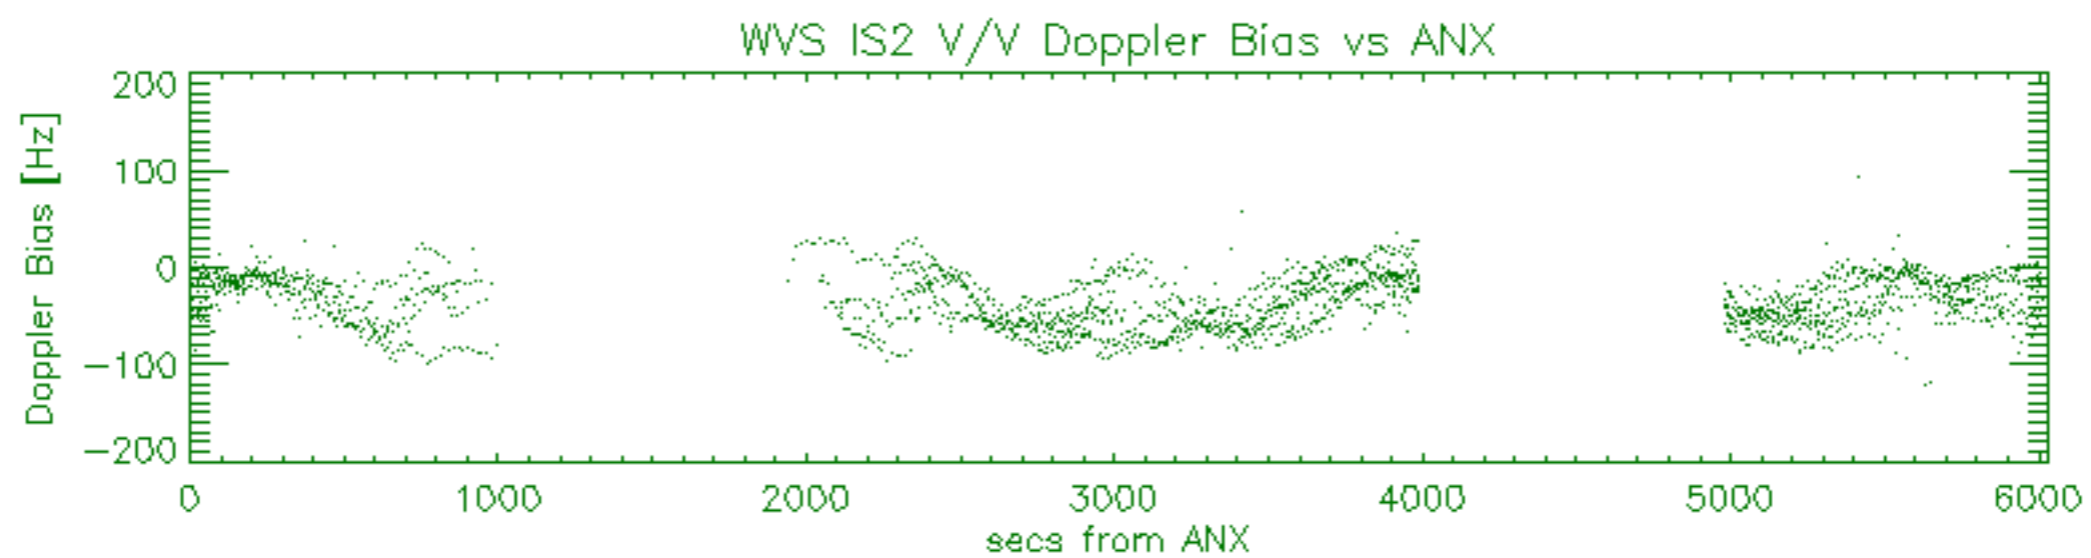
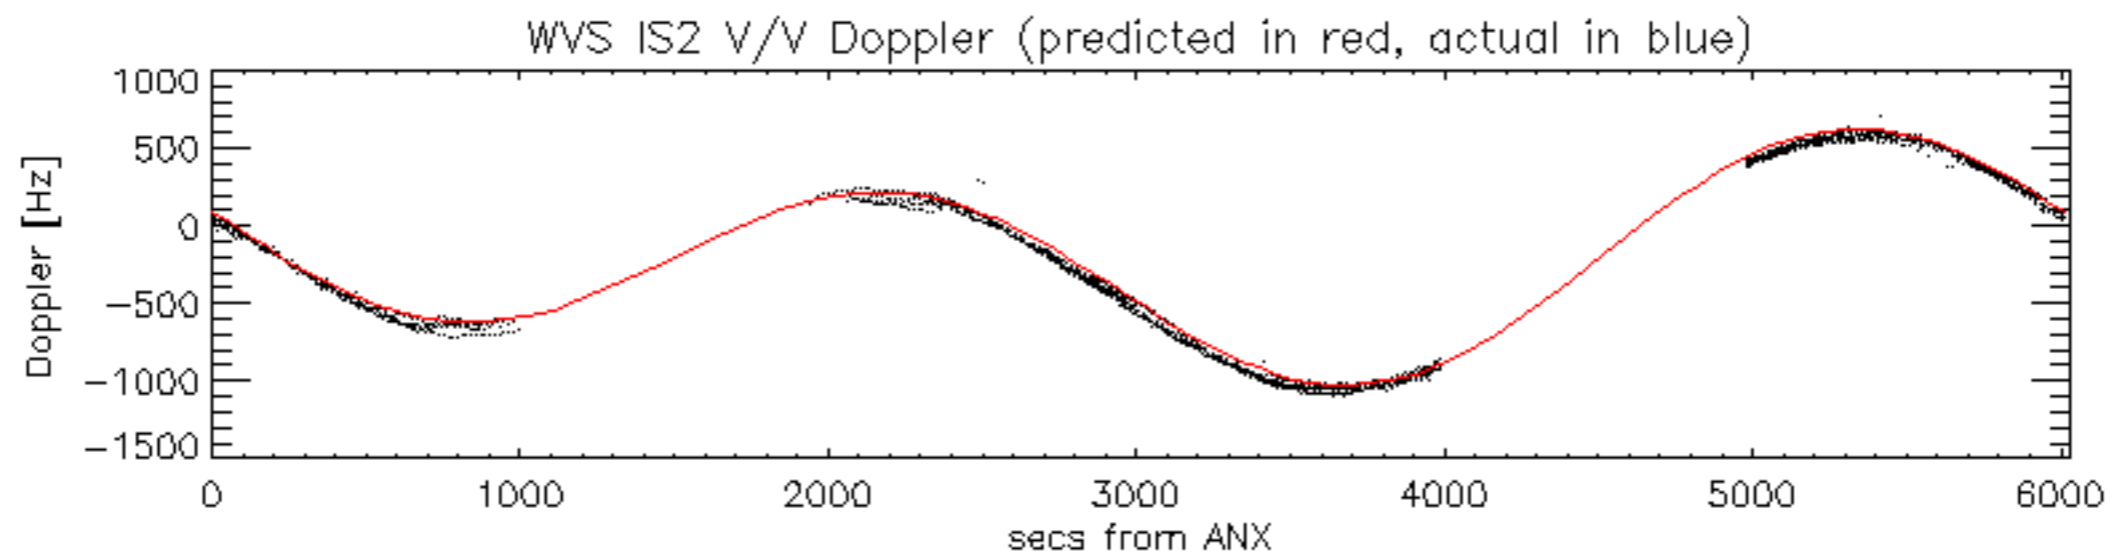





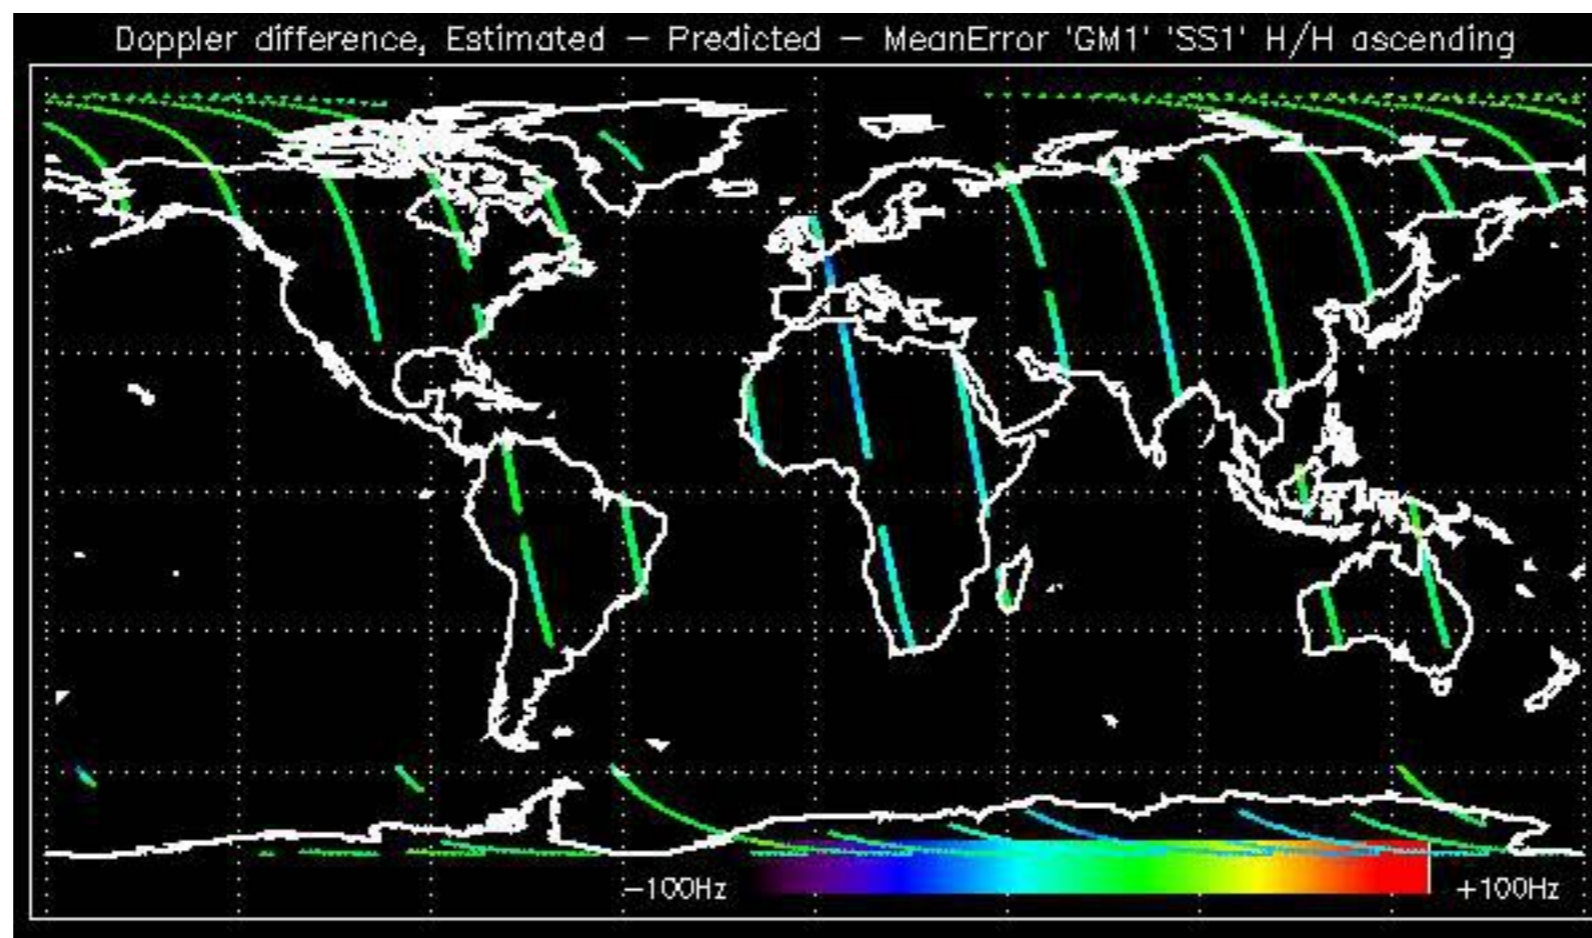


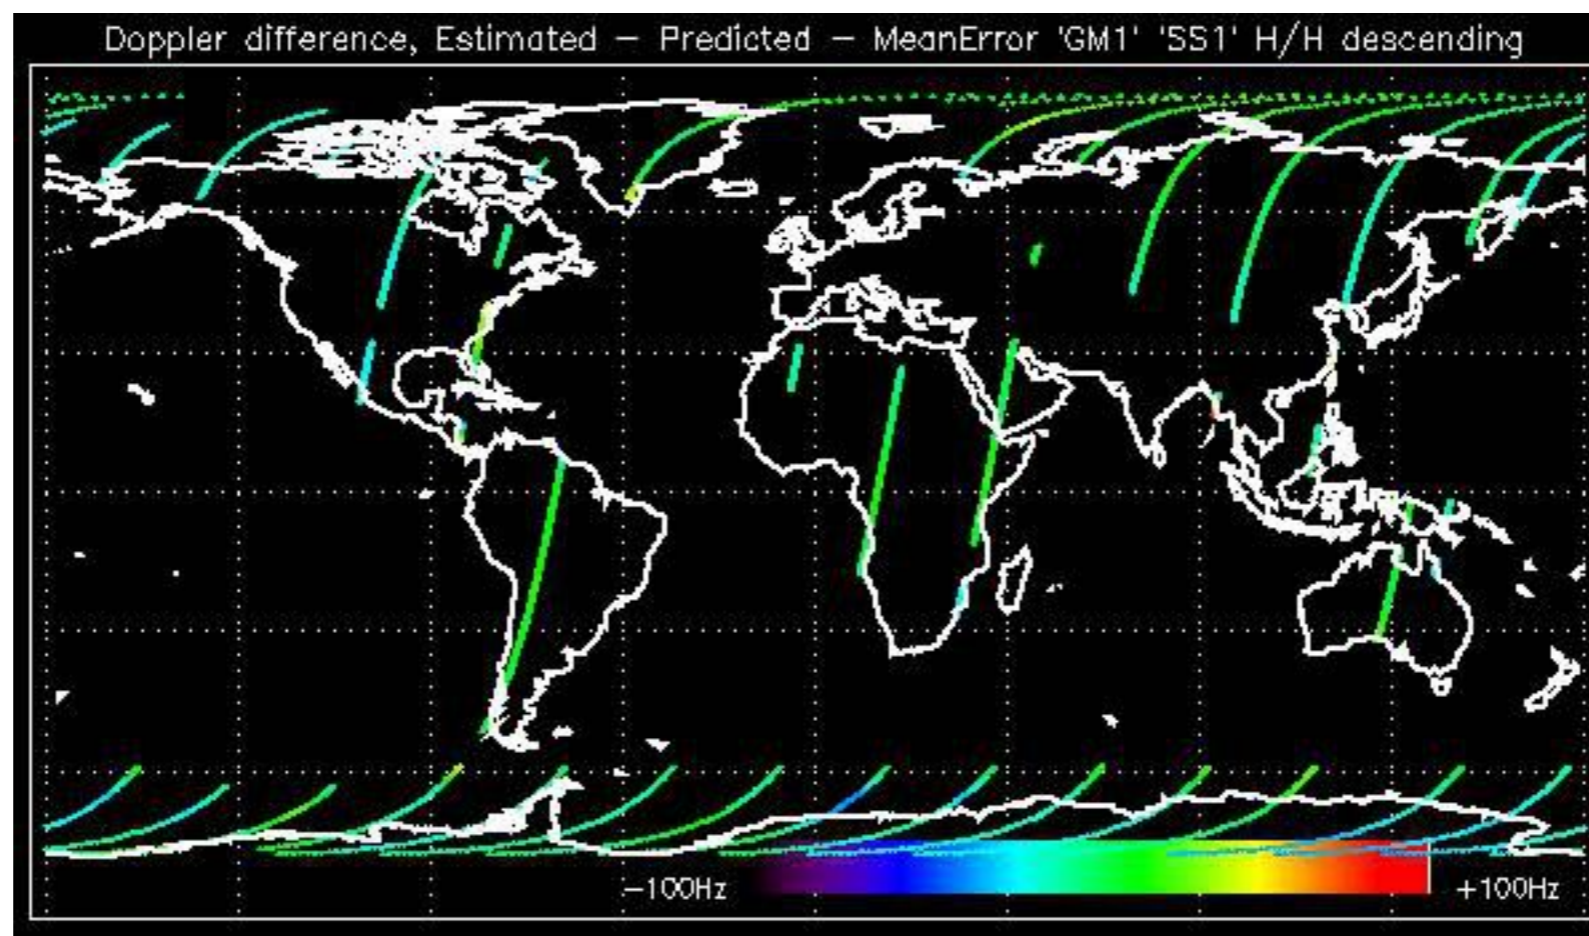




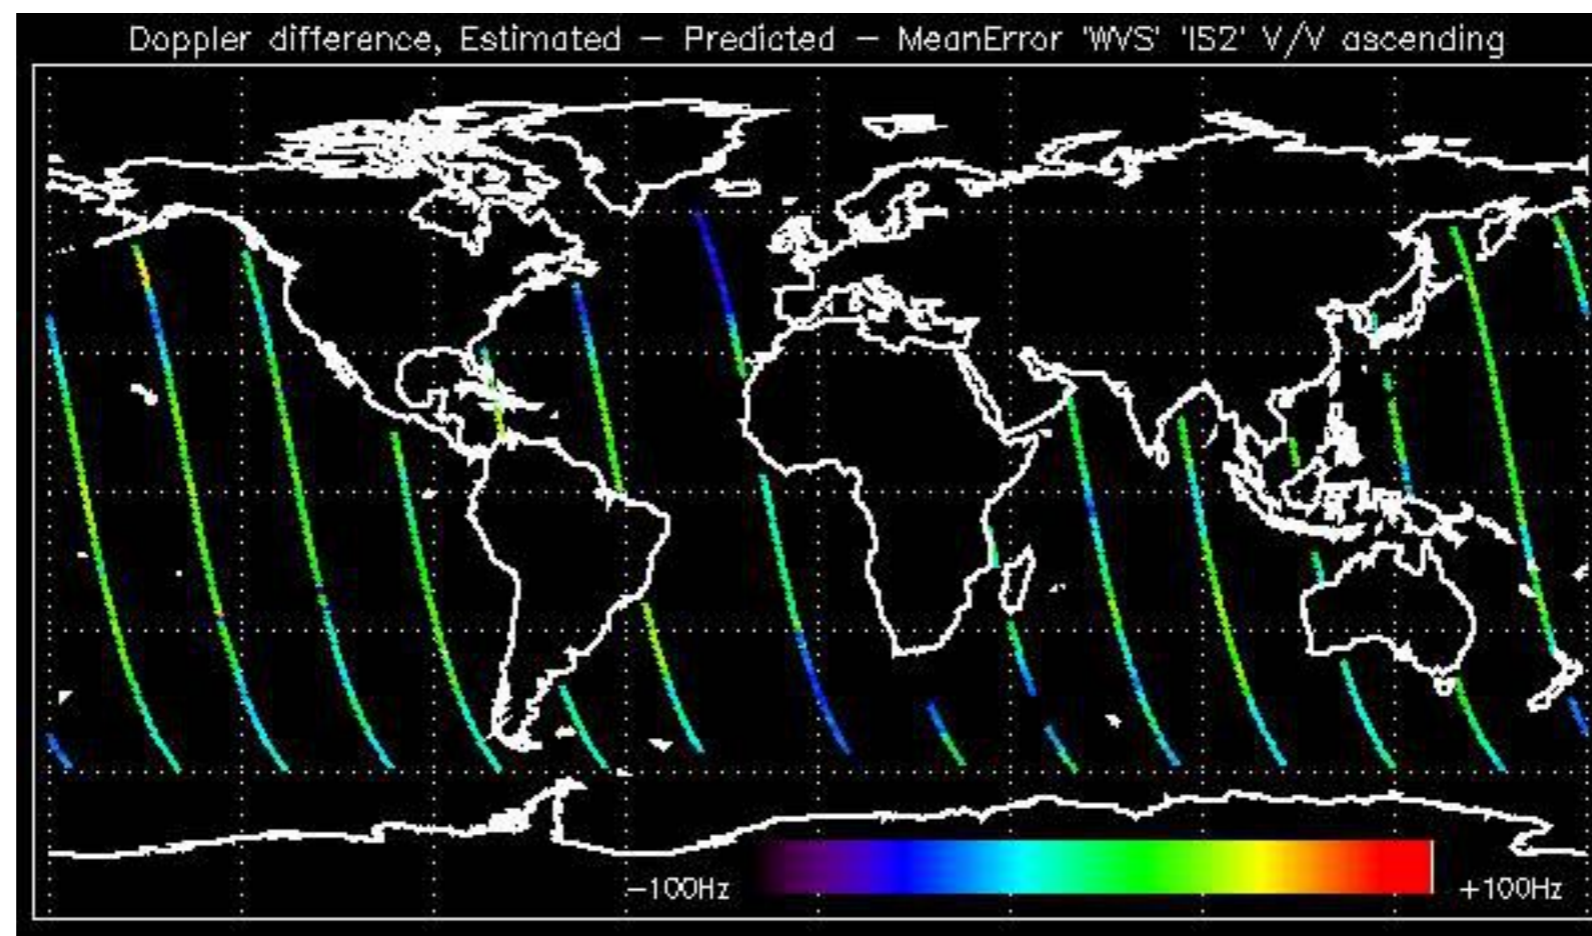


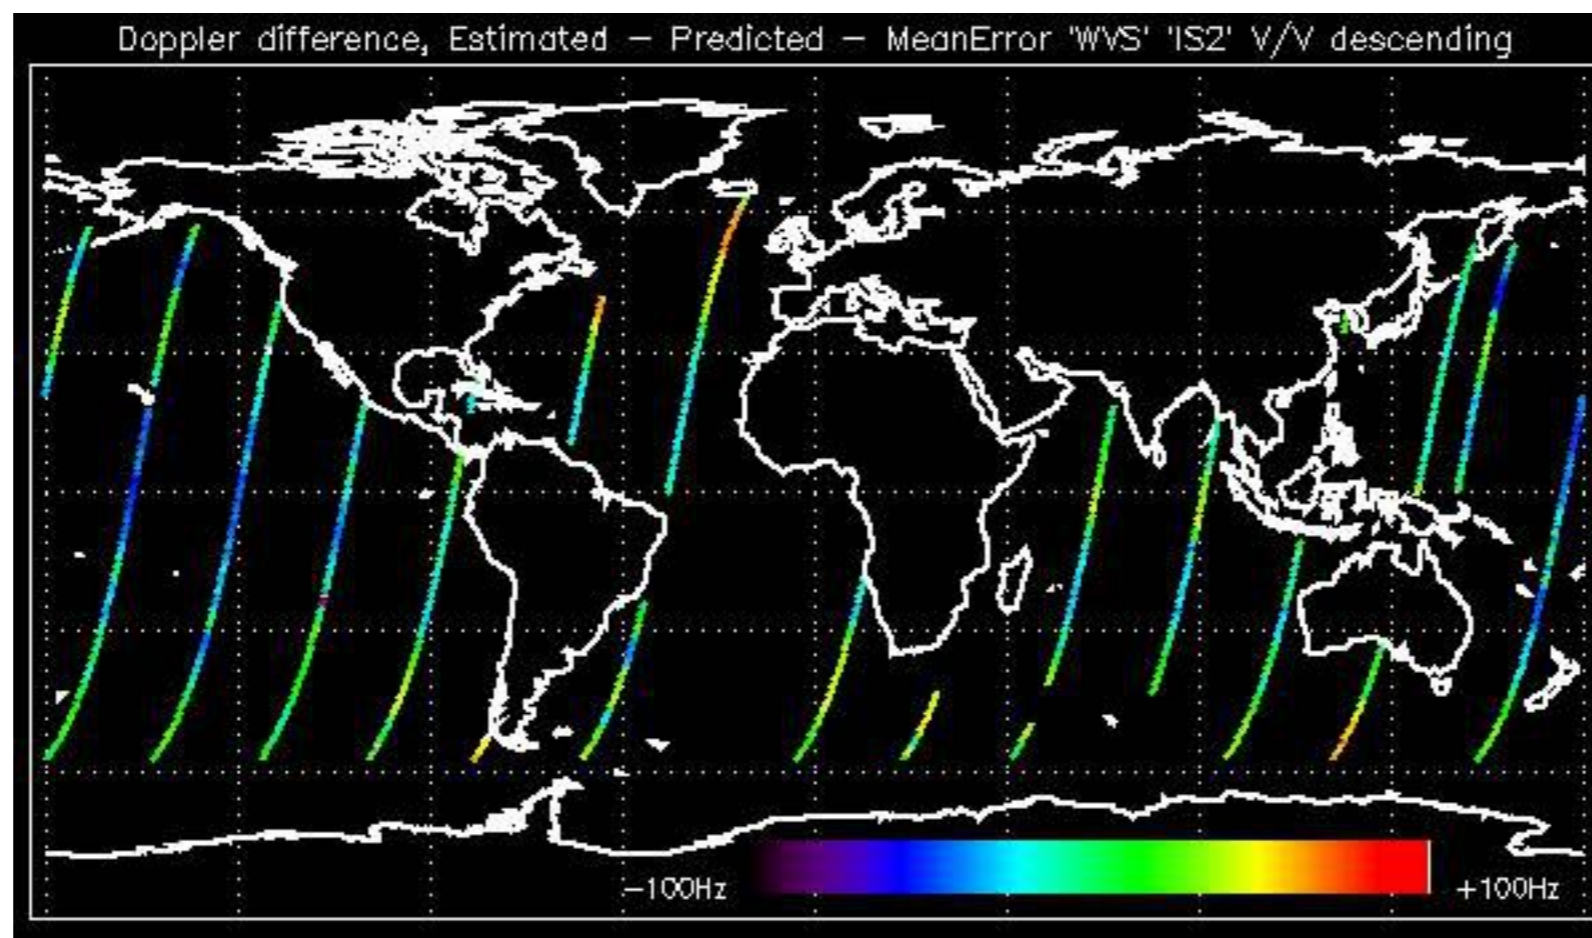


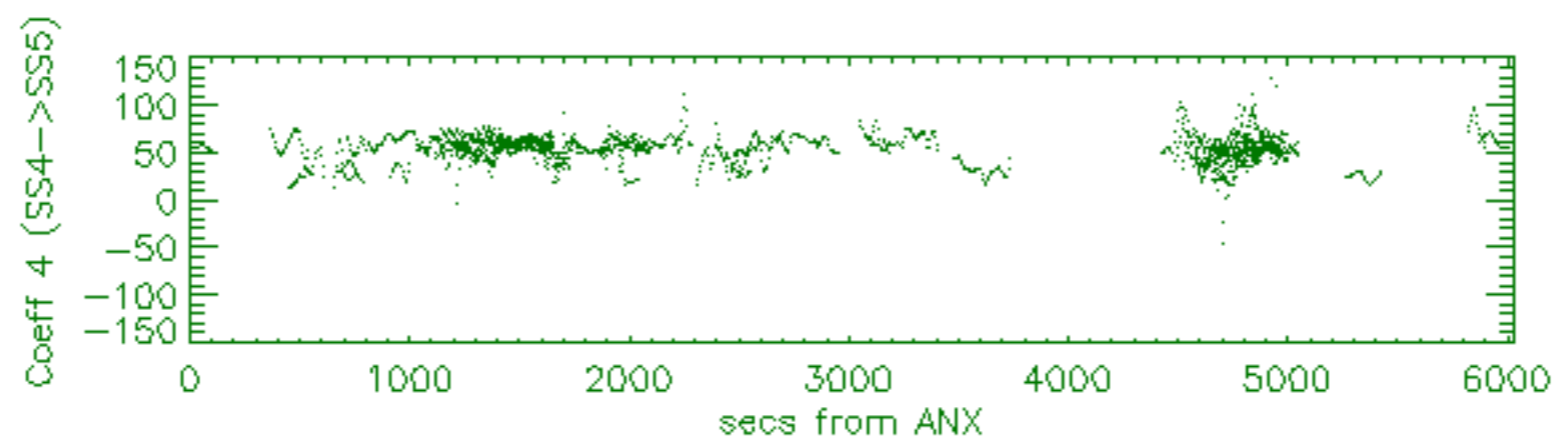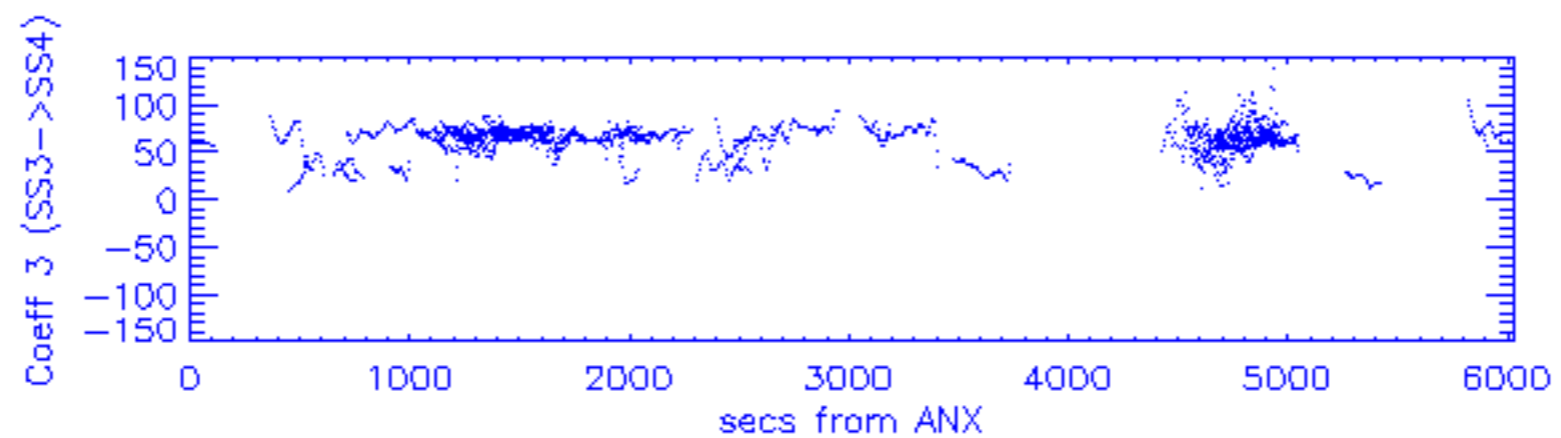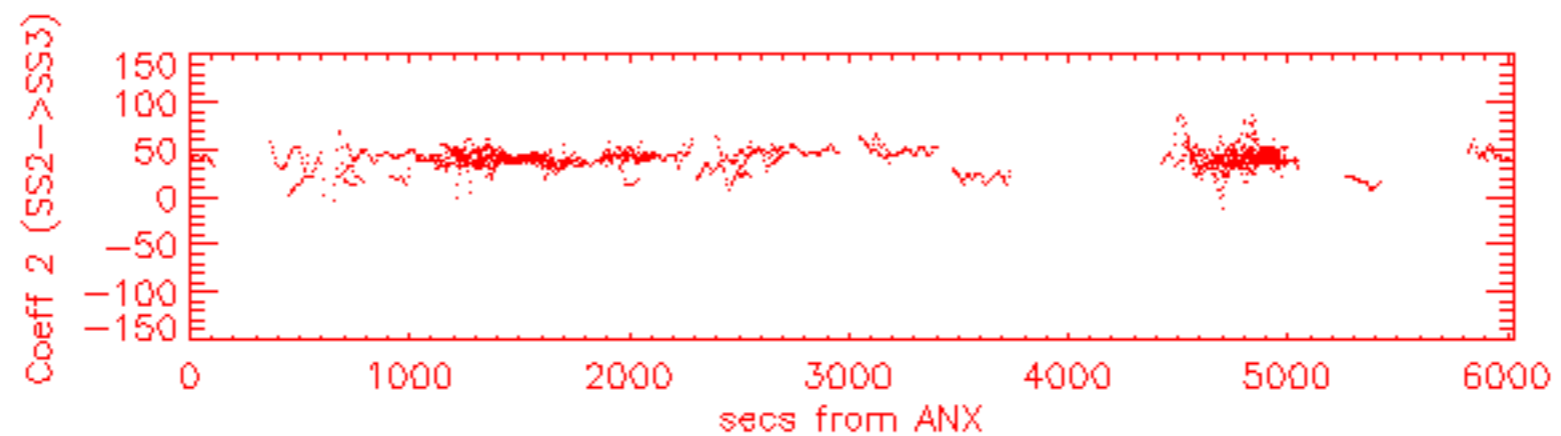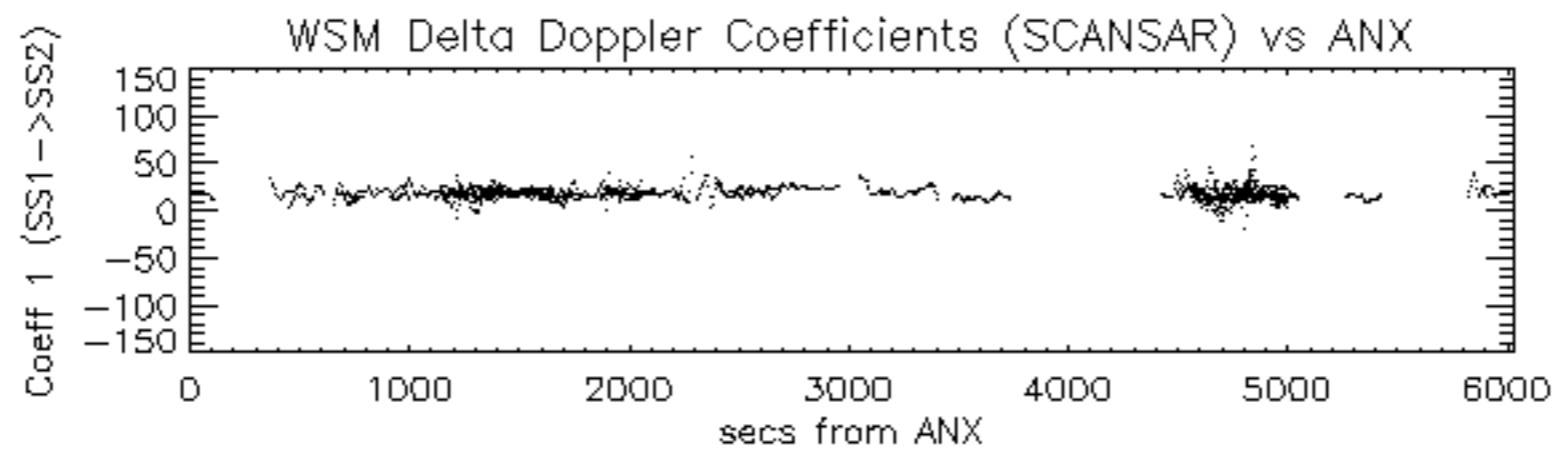

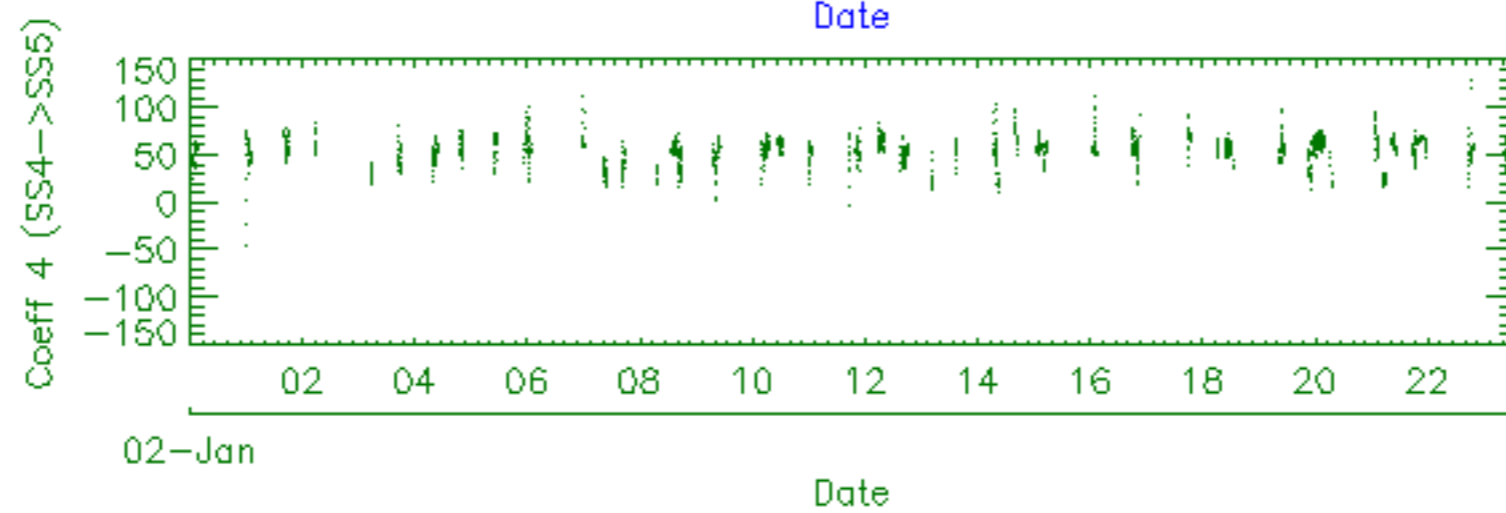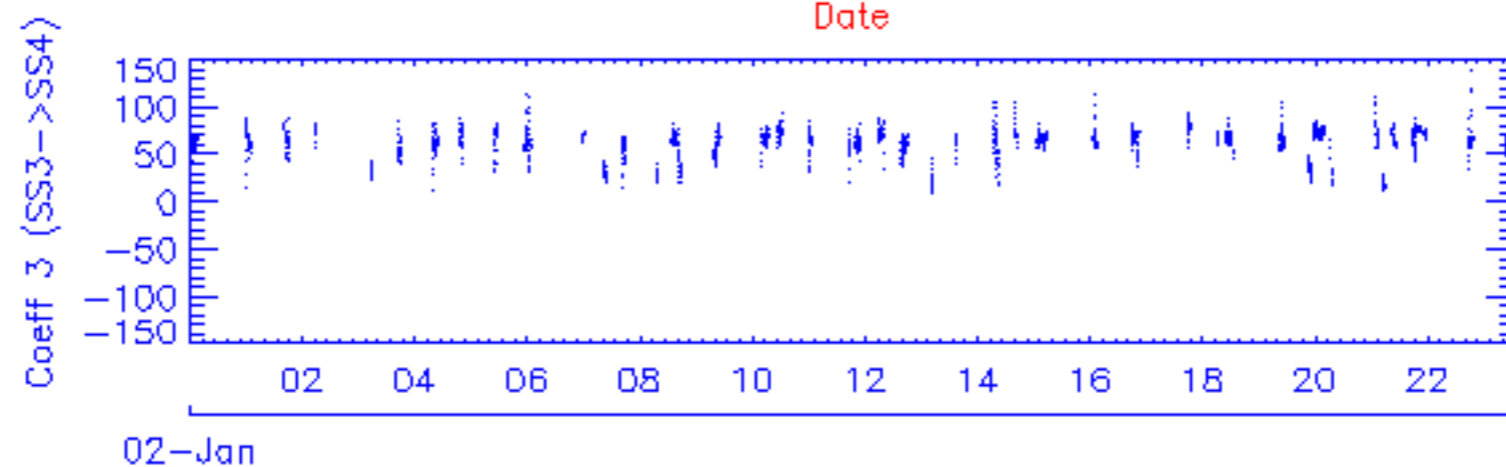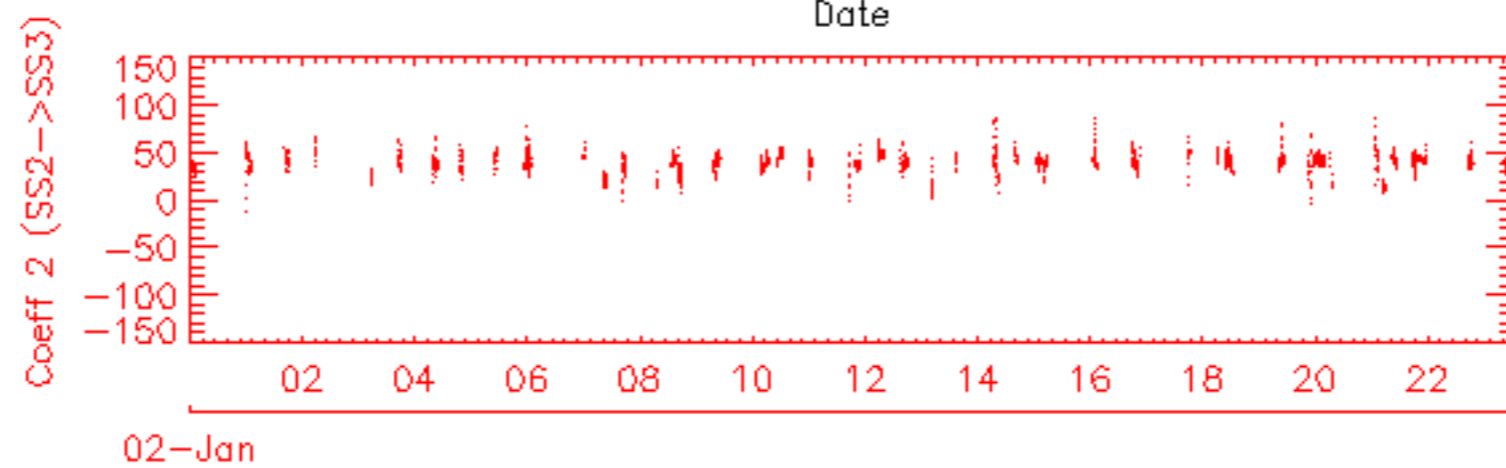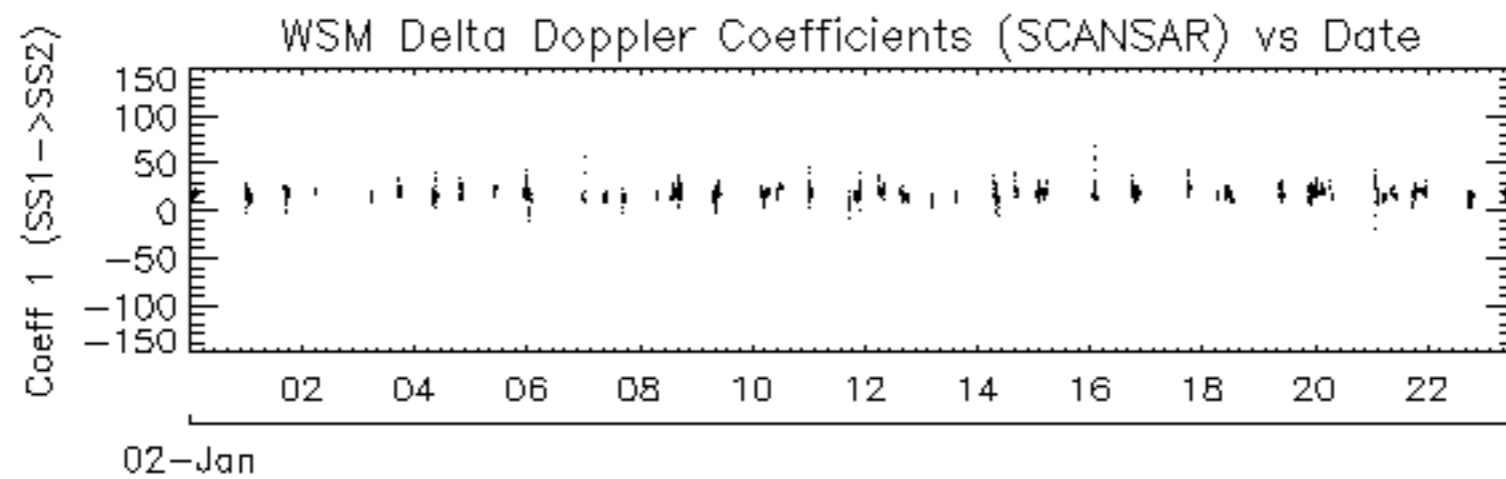


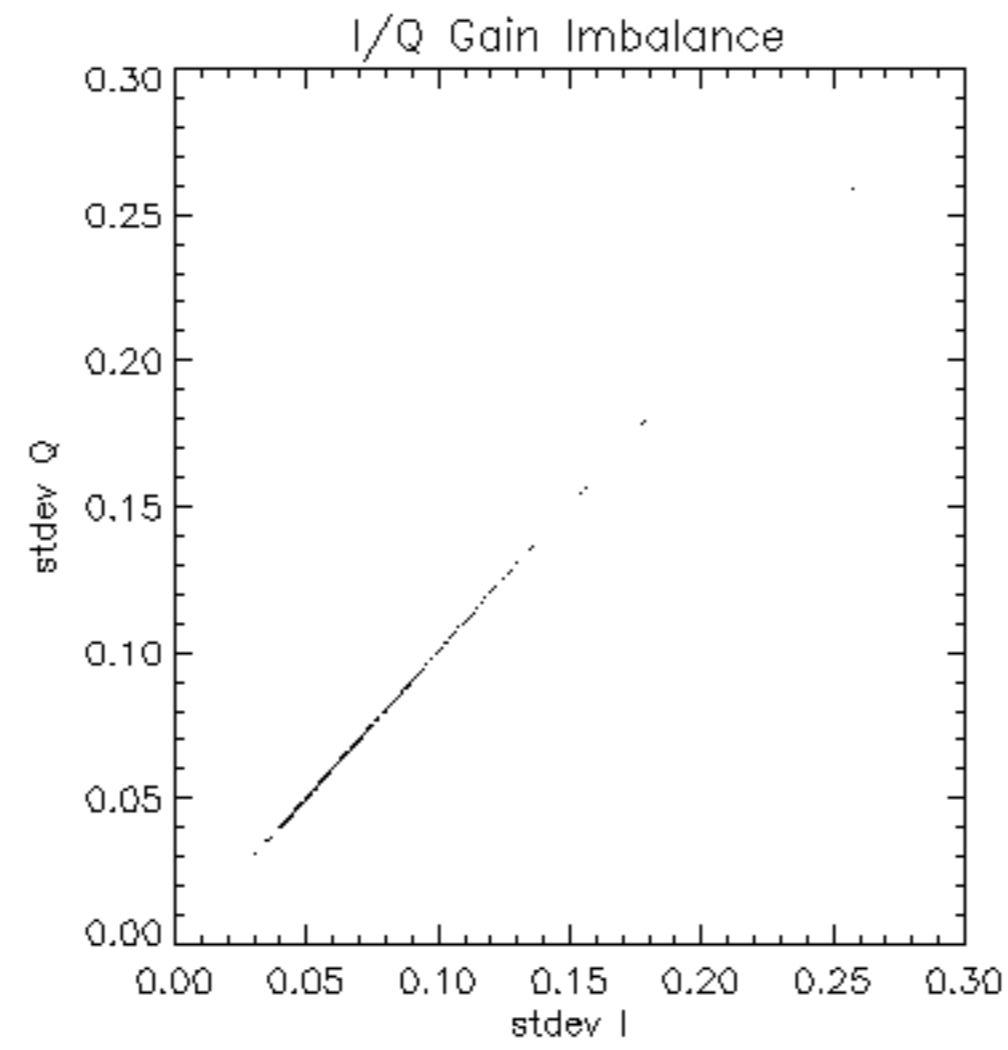

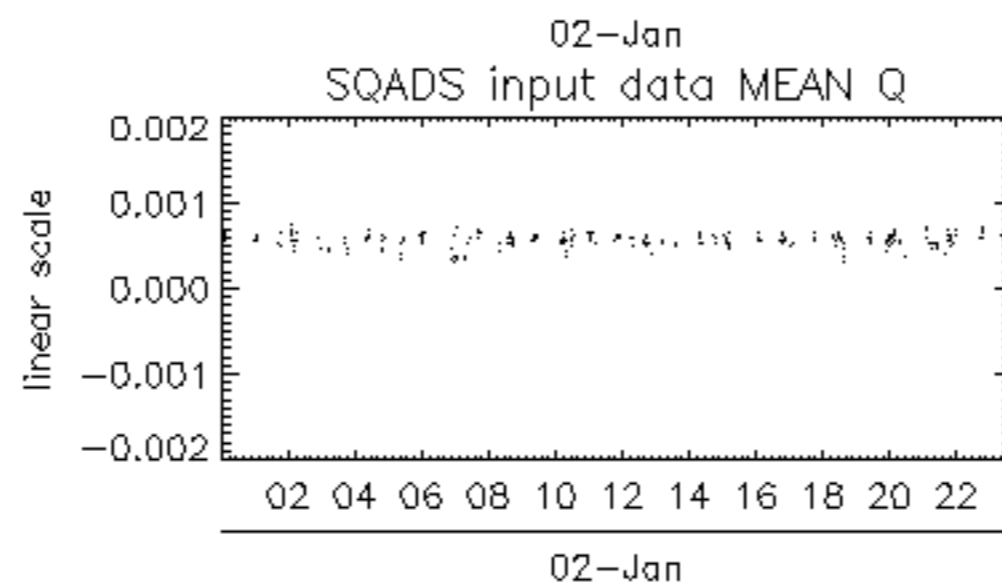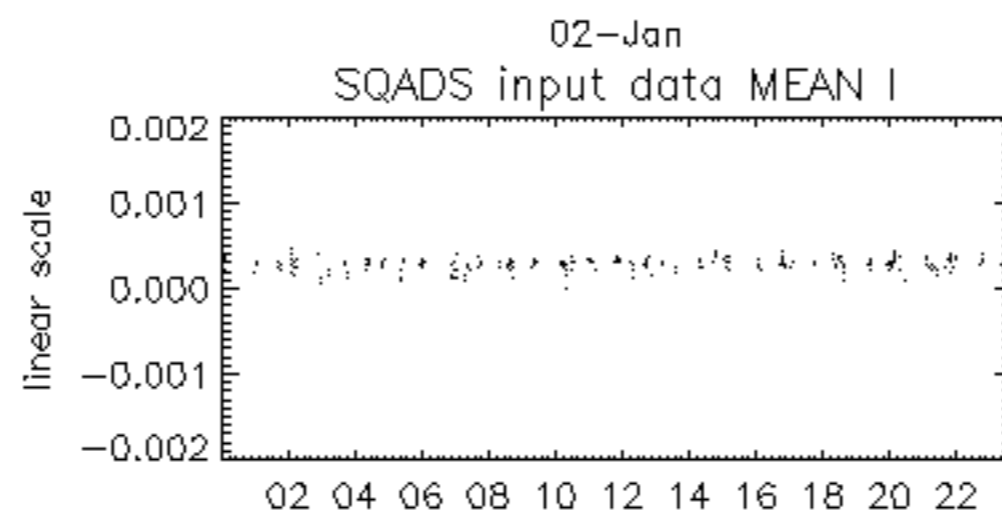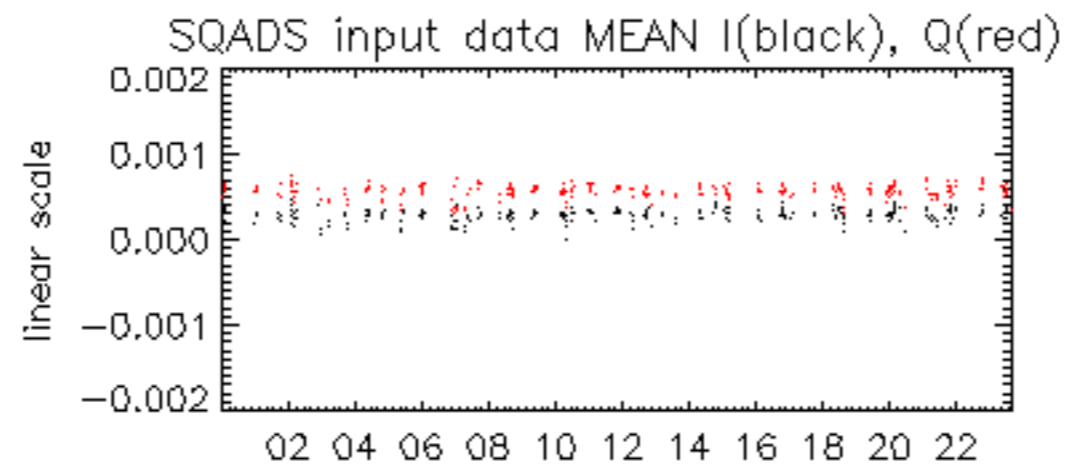


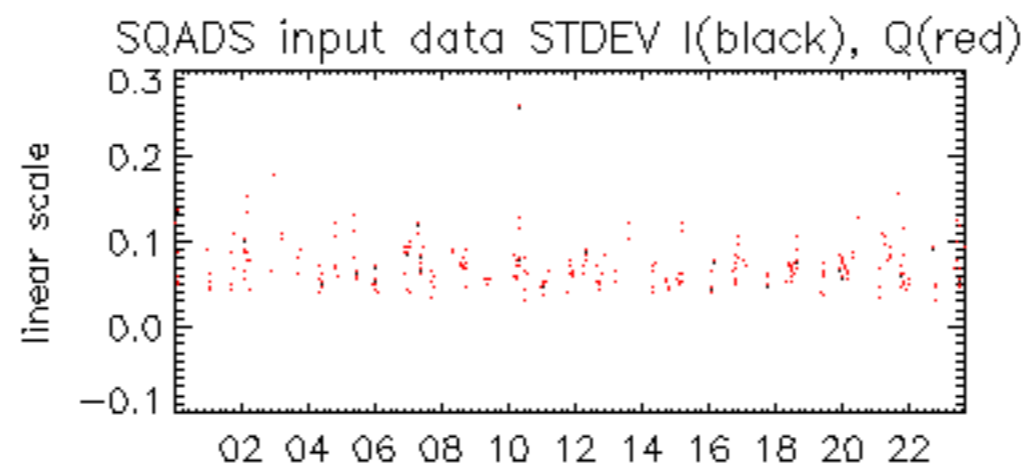

02-Jan

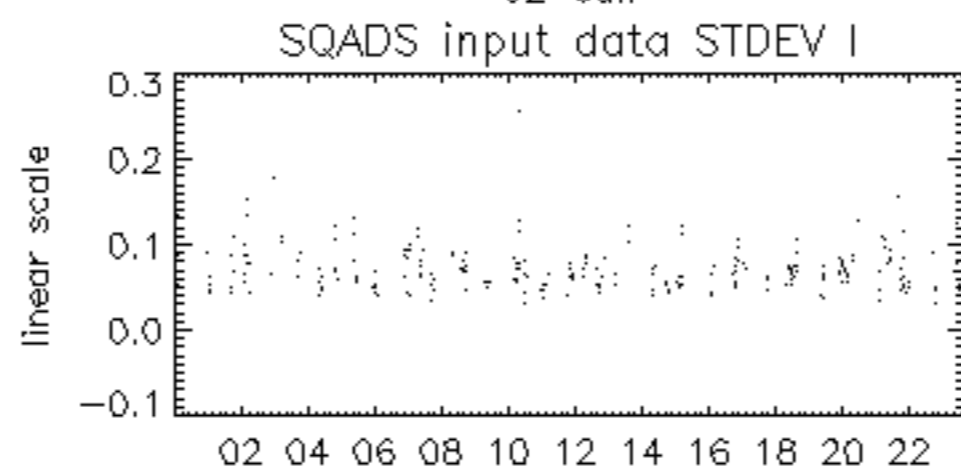

02-Jan

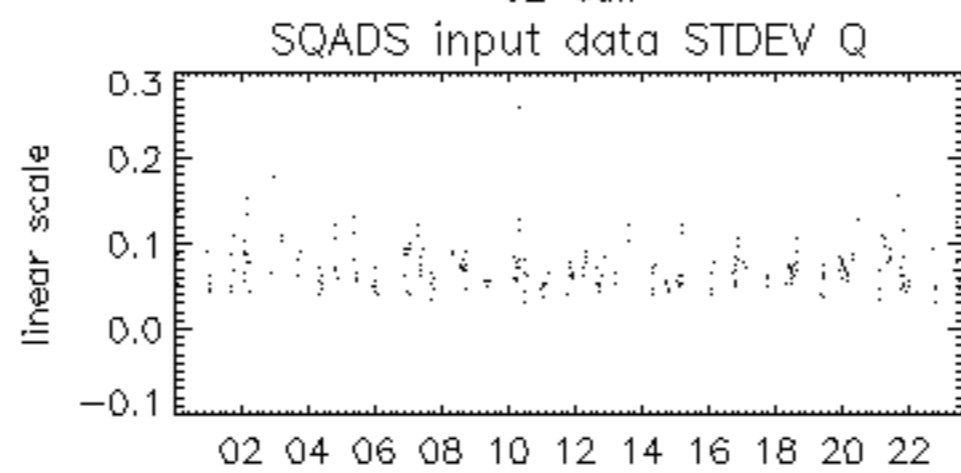

02-Jan

