



Analysis from 20-FEB-2012 00:00:00 to 20-FEB-2012 23:59:59. Page generated on 21-FEB-2012 13:28:14.
View log file: ASAR_Daily_Report_20120221_1327.log. For any anomalies please contact emma.hatton@vegaspaces.com, kajal.haria@vegaspaces.com.

This report is automatically generated every day, every 2 hours. No comments are provided on the results.

SUMMARY

1. DATA SUMMARY
 - 1.1 Summary tables
 - 1.2 Lists of products used
2. AUXILIARY FILES ANALYSIS
 - 2.1 IECF operational ADFs list
 - 2.2 Products with wrong ADFs
3. MODULE STEPPING PRODUCTS ANALYSIS
 - 3.1 V/V polarisation
 - 3.2 H/H polarisation
4. CALIBRATION PULSES ANALYSIS
 - 4.1 Analysis for WVS IS2 V/V
 - 4.1.1 Temporal Evolution Analysis for WVS IS2 V/V
 - 4.1.2 All Rows Analysis for WVS IS2 V/V
 - 4.2 Analysis for GM1 SS3 H/H
 - 4.2.1 Temporal Evolution Analysis for GM1 SS3 H/H
 - 4.2.2 All Rows Analysis for GM1 SS3 H/H
5. DOPPLER ANALYSIS
 - 5.1 Analysis for WVS IS2 V/V
 - 5.1.1 Doppler MAP Analysis for WVS IS2 V/V
 - 5.1.2 Doppler ANX Analysis for WVS IS2 V/V
 - 5.2 Analysis for GM1 SS1 H/H
 - 5.2.1 Doppler MAP Analysis for GM1 SS1 H/H
 - 5.2.2 Doppler ANX Analysis for GM1 SS1 H/H
 - 5.3 Doppler JUMPS Analysis for WSM
6. CHIRP ANALYSIS
 - 6.1 Analysis for WSM SS1 H/H
 - 6.1.1 ScaleFactor
 - 6.2 Analysis for WSM SS1 V/V
 - 6.2.1 ScaleFactor
7. RAW DATA ANALYSIS
 - 7.1 Analysis for WVS
 - 7.2 Analysis for IMM
8. TELEMETRY ANALYSIS
 - 8.1 Number of Missing Lines
 - 8.2 Number of Gaps

1 - DATA SUMMARY

1.1 - Summary tables

[[BACK TO MENU](#)]

WVS				GM1				APM				IMM				WSM				MS			
Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Beam	Pol	#	Center	Time	Pol	Modules
PDE	IS1	V/V	3	PDE	WS	H/H	39	PDE	IS1	V/H	4	PDE	IS2	V/V	3	PDE	WS	H/H	37	PDE	2012-02-20 00:51:56	V	320
PDE	IS2	V/V	30	PDK	WS	H/H	47	PDE	IS2	H/H	1	PDE	IS3	H/H	1	PDE	WS	V/V	3	PDE	2012-02-20 22:34:57	H	320
PDK	IS2	V/V	25					PDE	IS2	V/H	1	PDE	IS5	V/V	1	PDK	WS	H/H	18				
								PDE	IS4	H/H	1	PDE	IS6	H/H	6	PDK	WS	V/V	1				
								PDE	IS4	V/H	1	PDE	IS7	V/V	1								
												PDK	IS2	V/V	1								
												PDK	IS6	H/H	1								

1.2 - Lists of products used

[[BACK TO MENU](#)]

[[TXT](#)] [[XLS](#)] [List_WVS_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_GM1_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_APM_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_IMM_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_WSM_products_used](#)
 [[TXT](#)] [[XLS](#)] [List_MS_products_used](#)

2 - AUXILIARY FILES ANALYSIS

2.1 - IECF operational ADFs list

[[BACK TO MENU](#)]

ADFs disseminated for ASAR
ASA_CON_AXVIEC20110526_075001_20101027_215740_20141231_000000
ASA_INS_AXVIEC20110124_114858_20101228_112000_20141231_235959
ASA_XCH_AXVIEC20101222_143057_20020301_000000_20141231_000000
ASA_XCA_AXVIEC20120126_110323_20110607_000000_20141231_000000

2.2 - Products with wrong ADFs





[[BACK TO MENU](#)]

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
WVS	0	0	0	0
GM1	0	0	0	0
APM	0	0	0	0
IMM	0	0	0	0
WSM	0	0	0	0

[[TXT](#)] [[XLS](#)] [Check_ADFs_WVS](#)
 [[TXT](#)] [[XLS](#)] [Check_ADFs_GM1](#)
 [[TXT](#)] [[XLS](#)] [Check_ADFs_APM](#)
 [[TXT](#)] [[XLS](#)] [Check_ADFs_IMM](#)
 [[TXT](#)] [[XLS](#)] [Check_ADFs_WSM](#)

3 - MODULE STEPPING PRODUCTS ANALYSIS



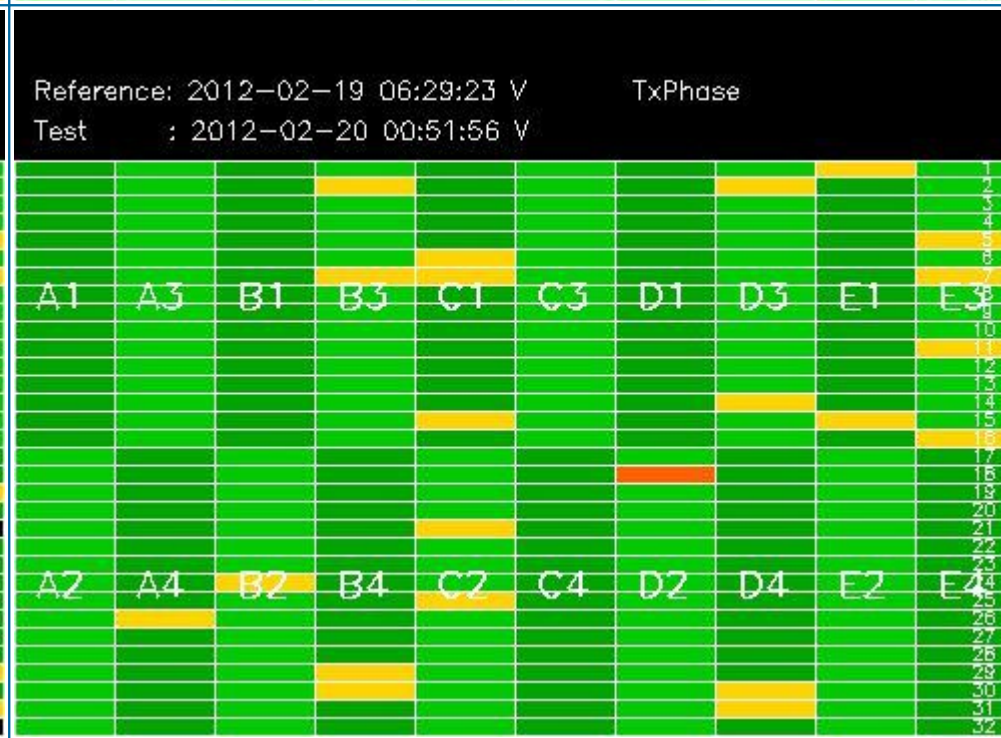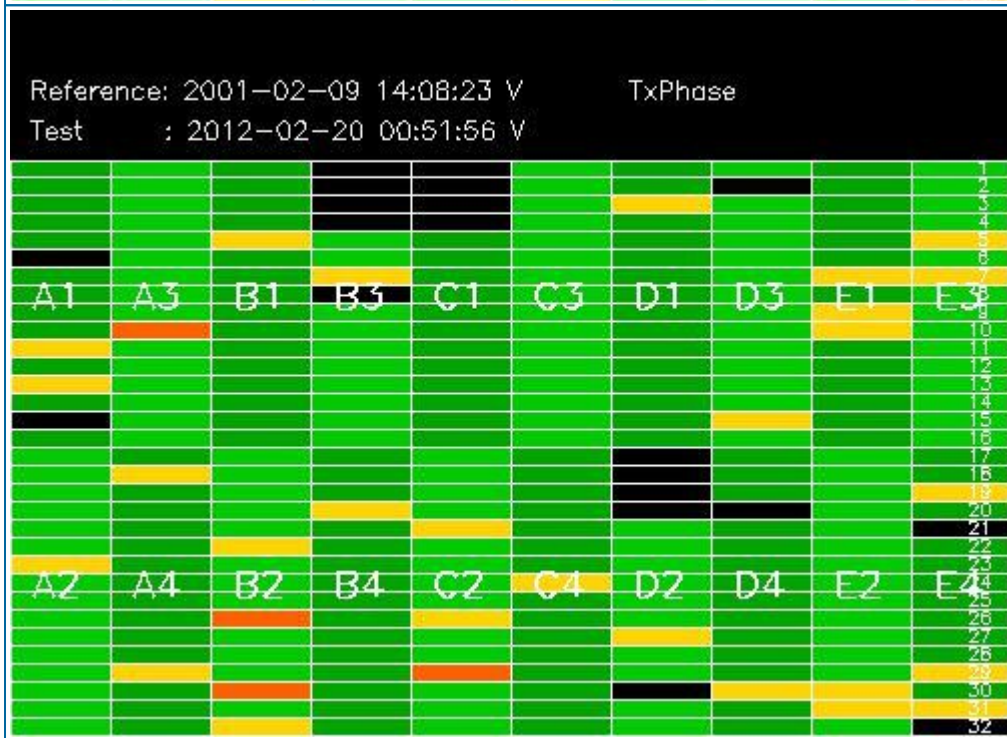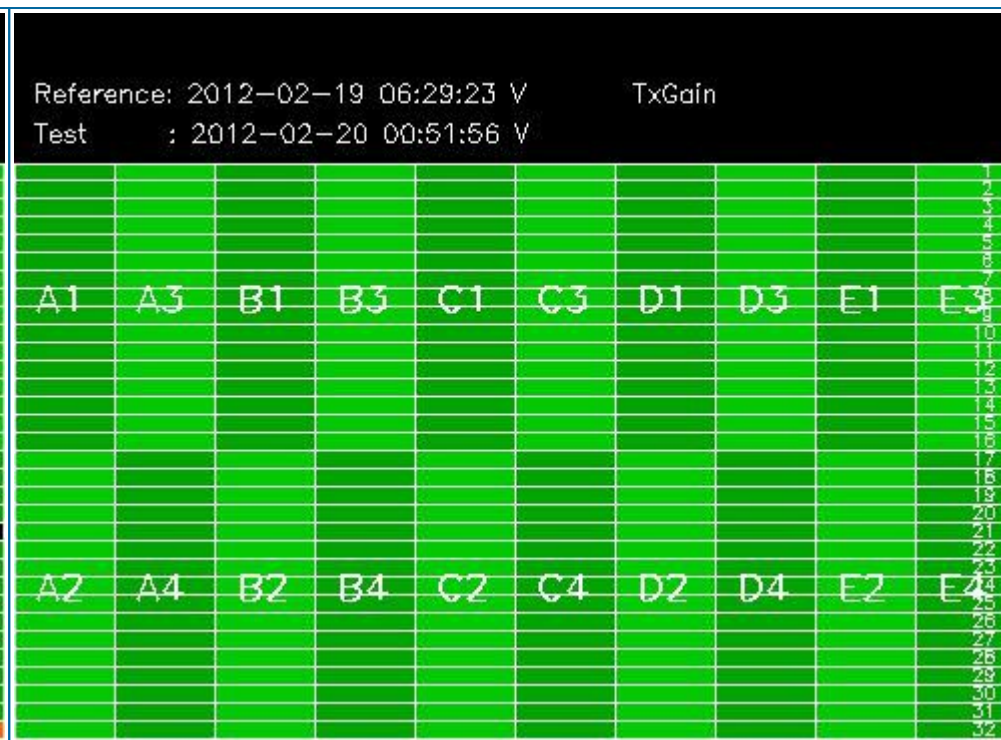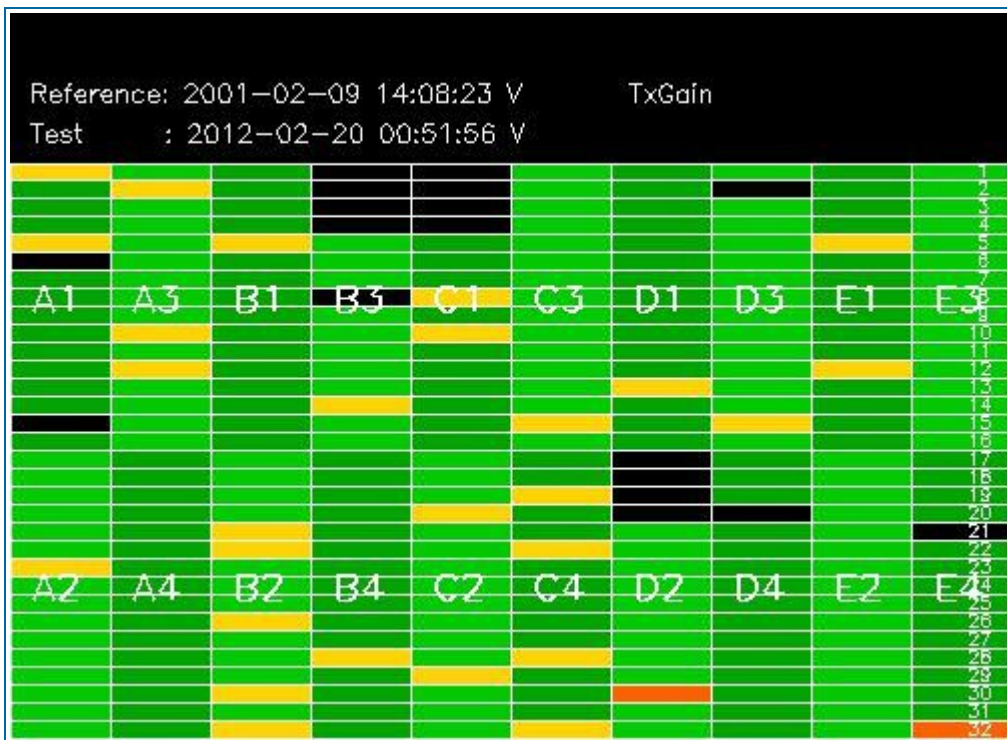

3.2 - H/H polarisation


[[BACK TO MENU](#)]

SECOND FIXED REFERENCE	PREVIOUS PRODUCT REFERENCE
Pre-launch reference (2001-02-09)	Previous product in the same polarisation

Reference: 2001-02-09 13:50:42 H RxGain
 Test : 2012-02-20 22:34:57 H




Reference: 2012-02-19 23:11:42 H RxGain
 Test : 2012-02-20 22:34:57 H




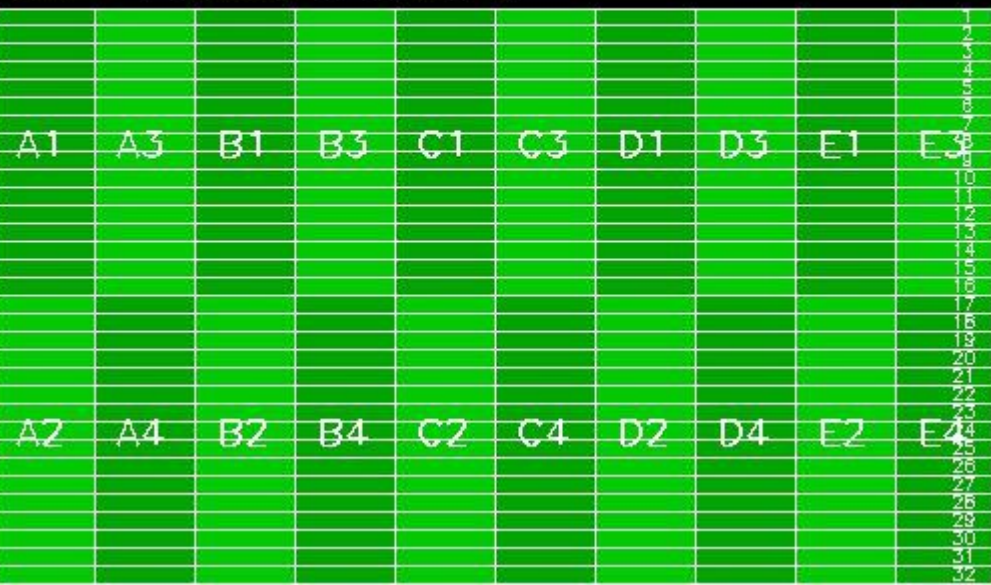


Reference: 2001-02-09 13:50:42 H RxPhase
 Test : 2012-02-20 22:34:57 H



Reference: 2012-02-19 23:11:42 H RxPhase
 Test : 2012-02-20 22:34:57 H

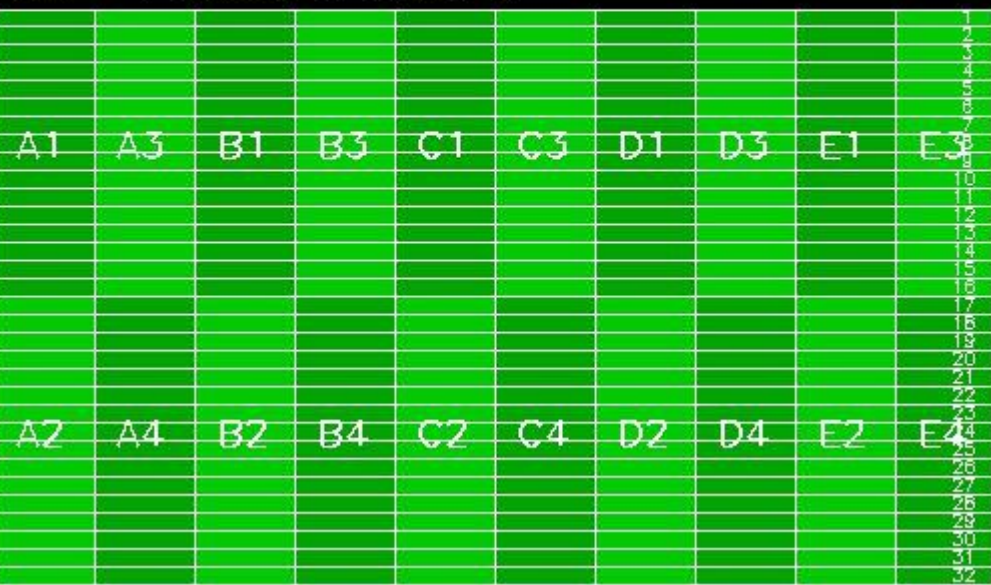

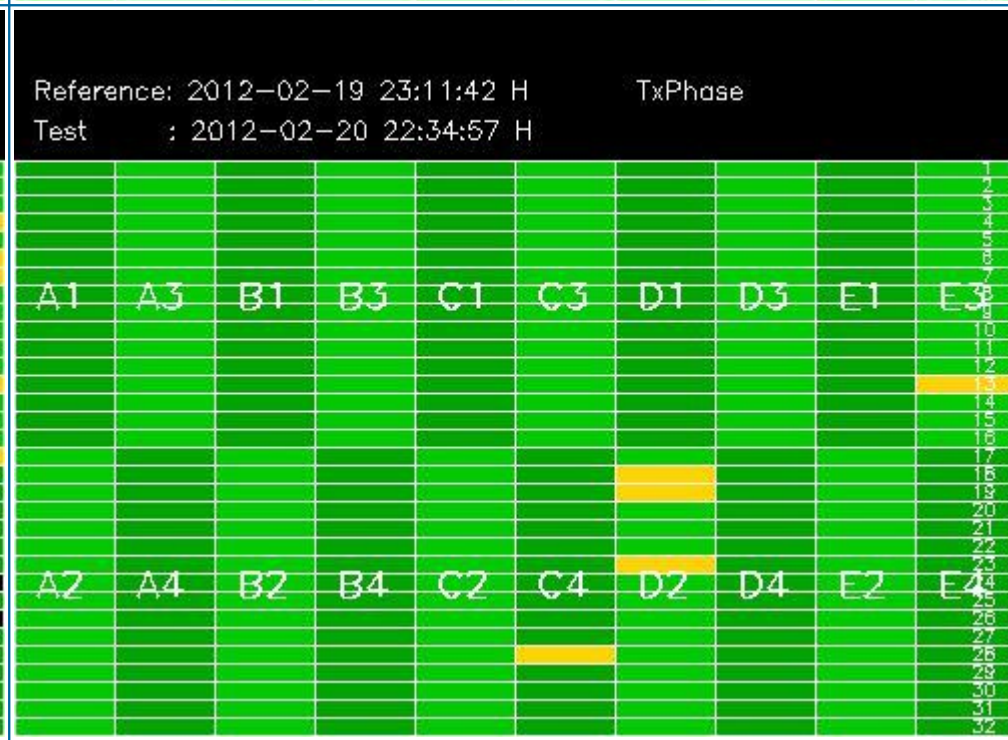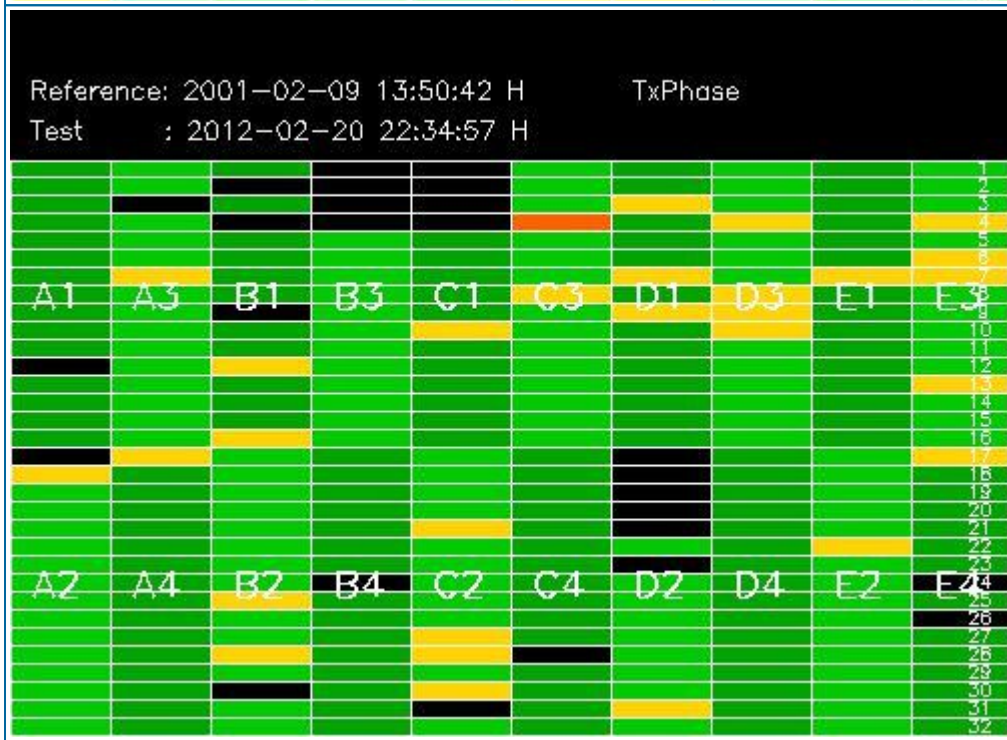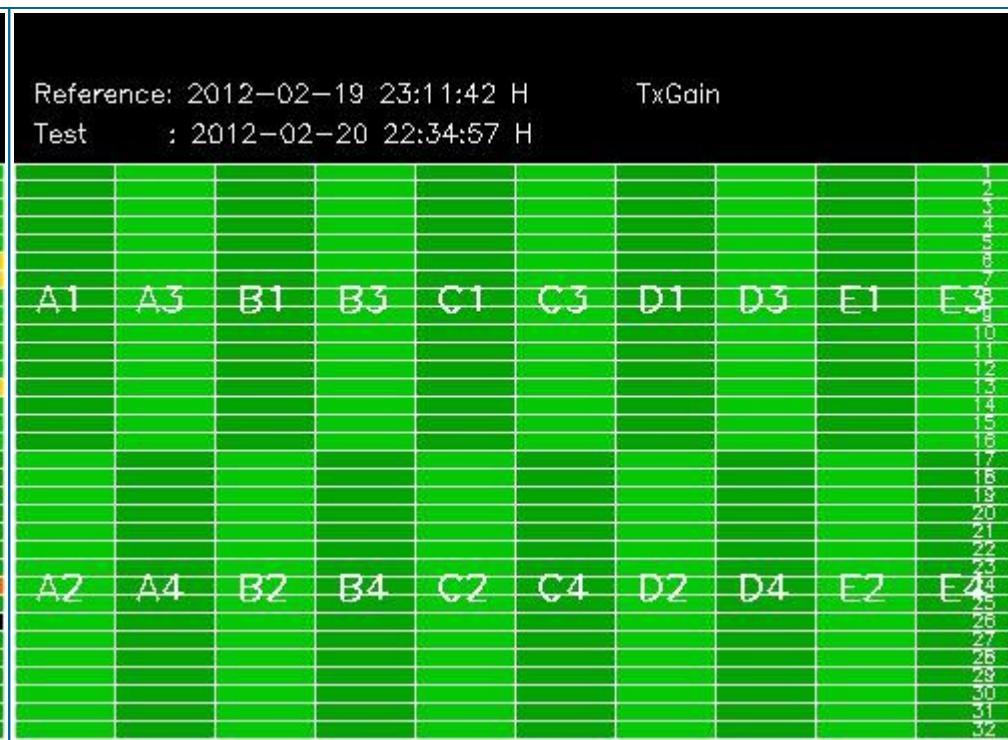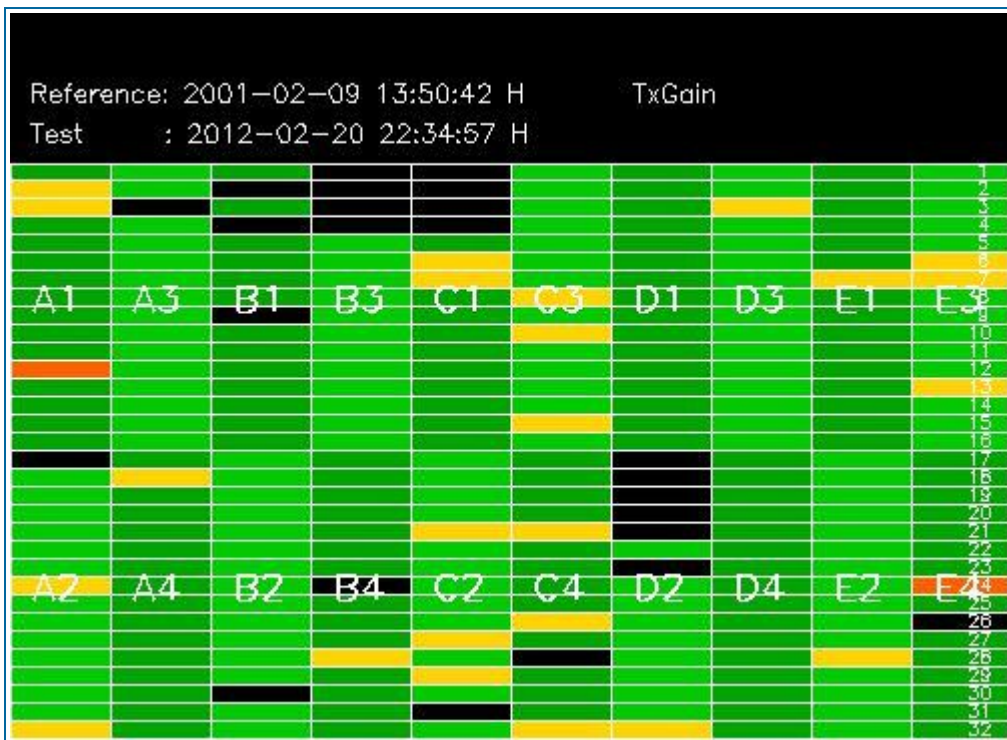

4 - CALIBRATION PULSES ANALYSIS

4.1 - Analysis for WVS IS2 V/V


4.1.1 - Temporal Evolution Analysis for WVS IS2 V/V

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for WVS IS2 V/V

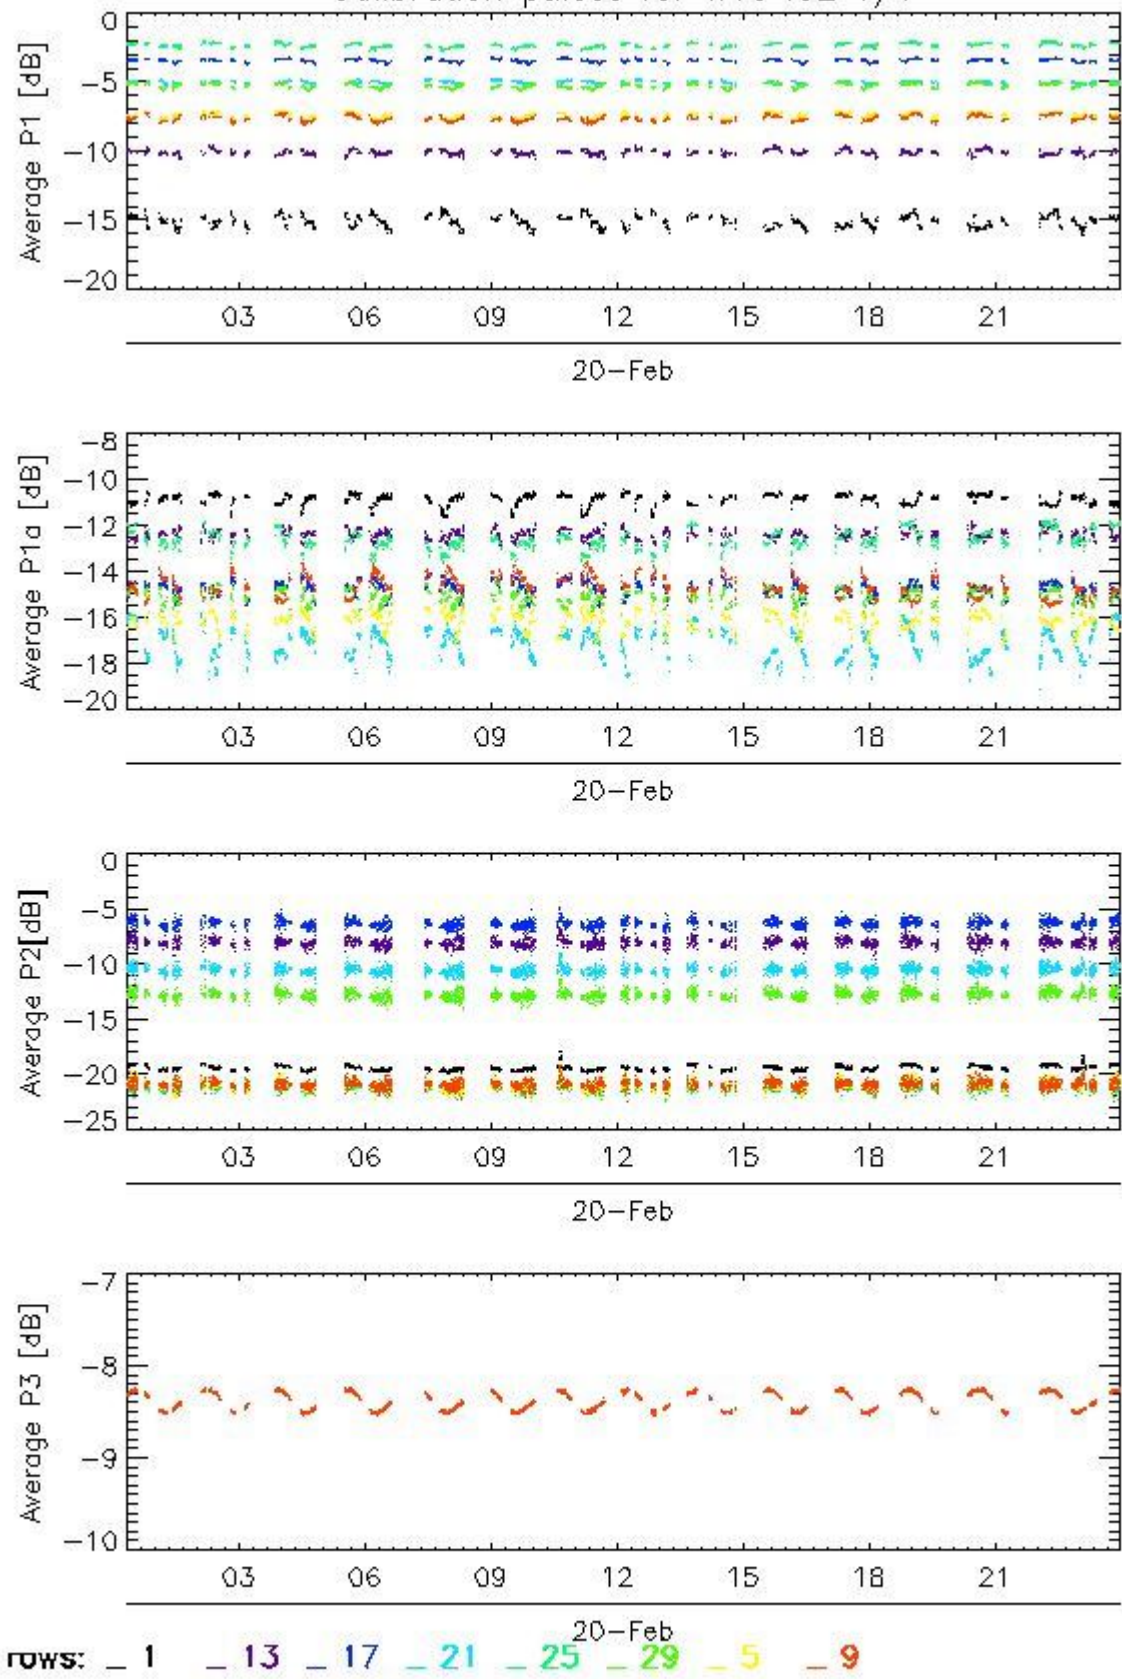


Transmit power (P1 - P1a) for WVS IS2 V/V

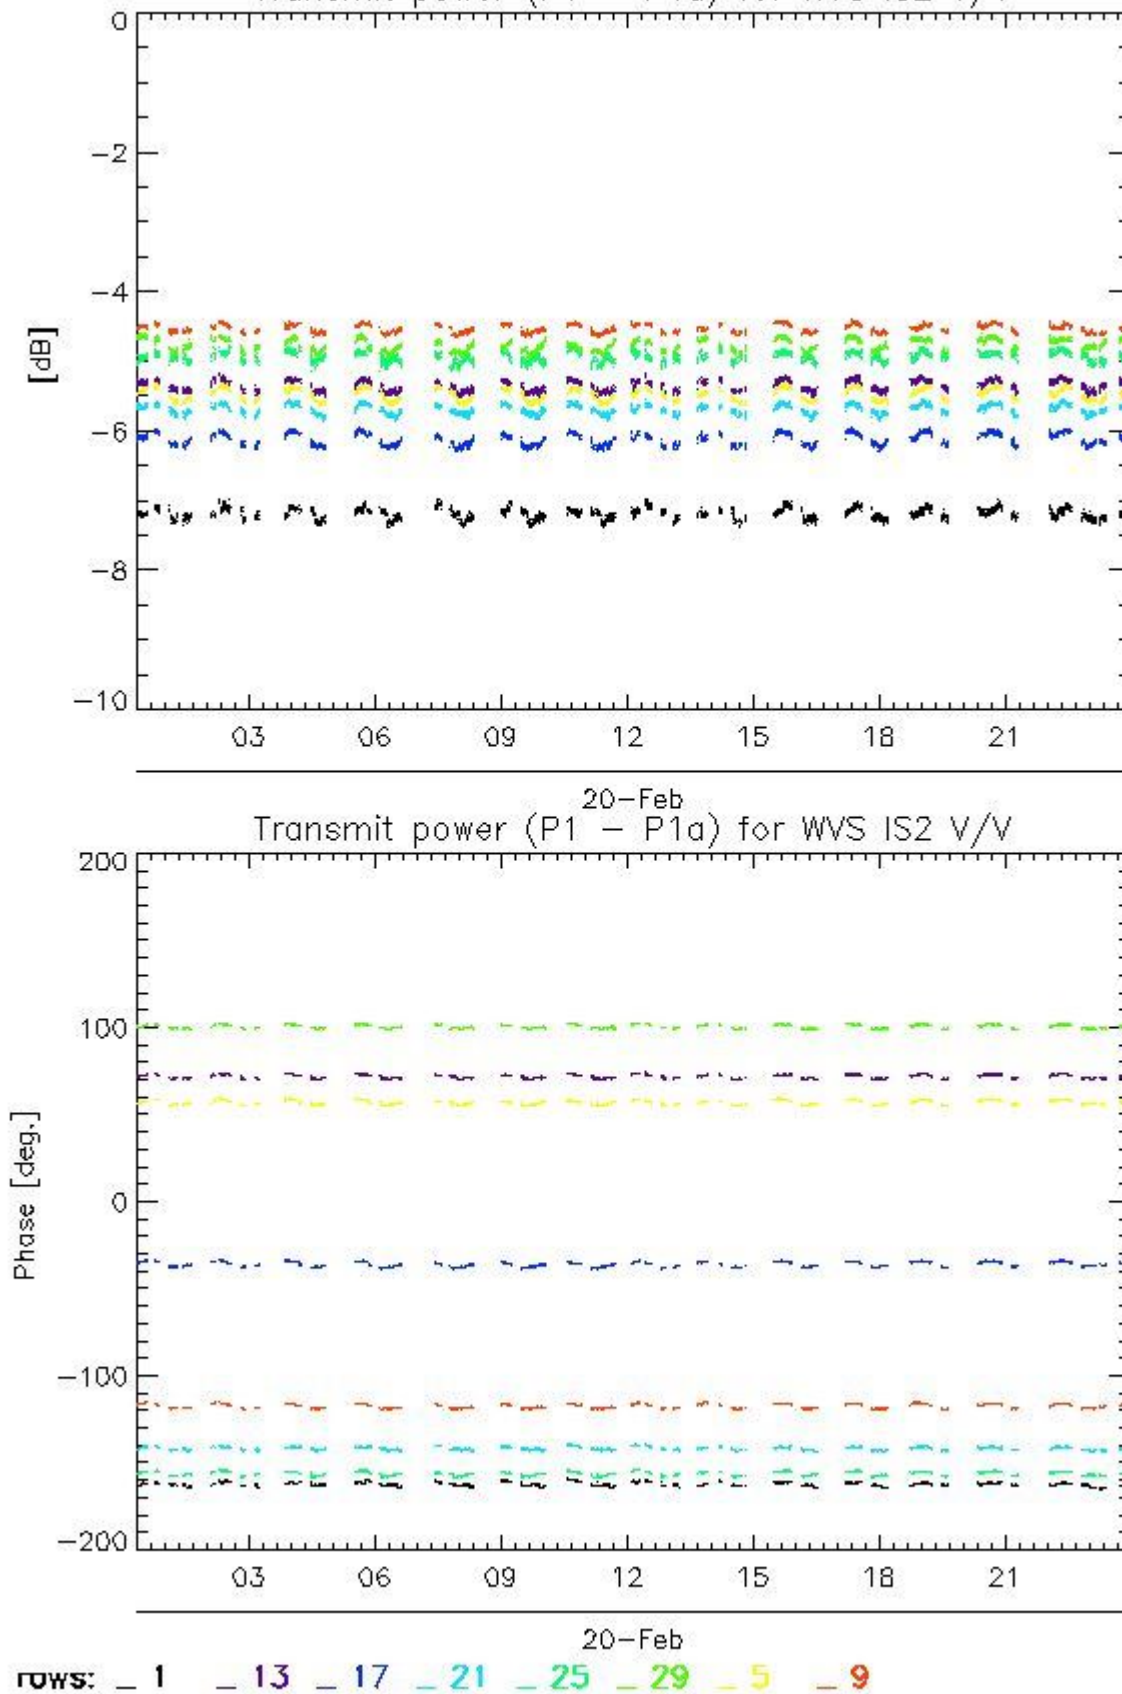

4.1.2 - All Rows Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



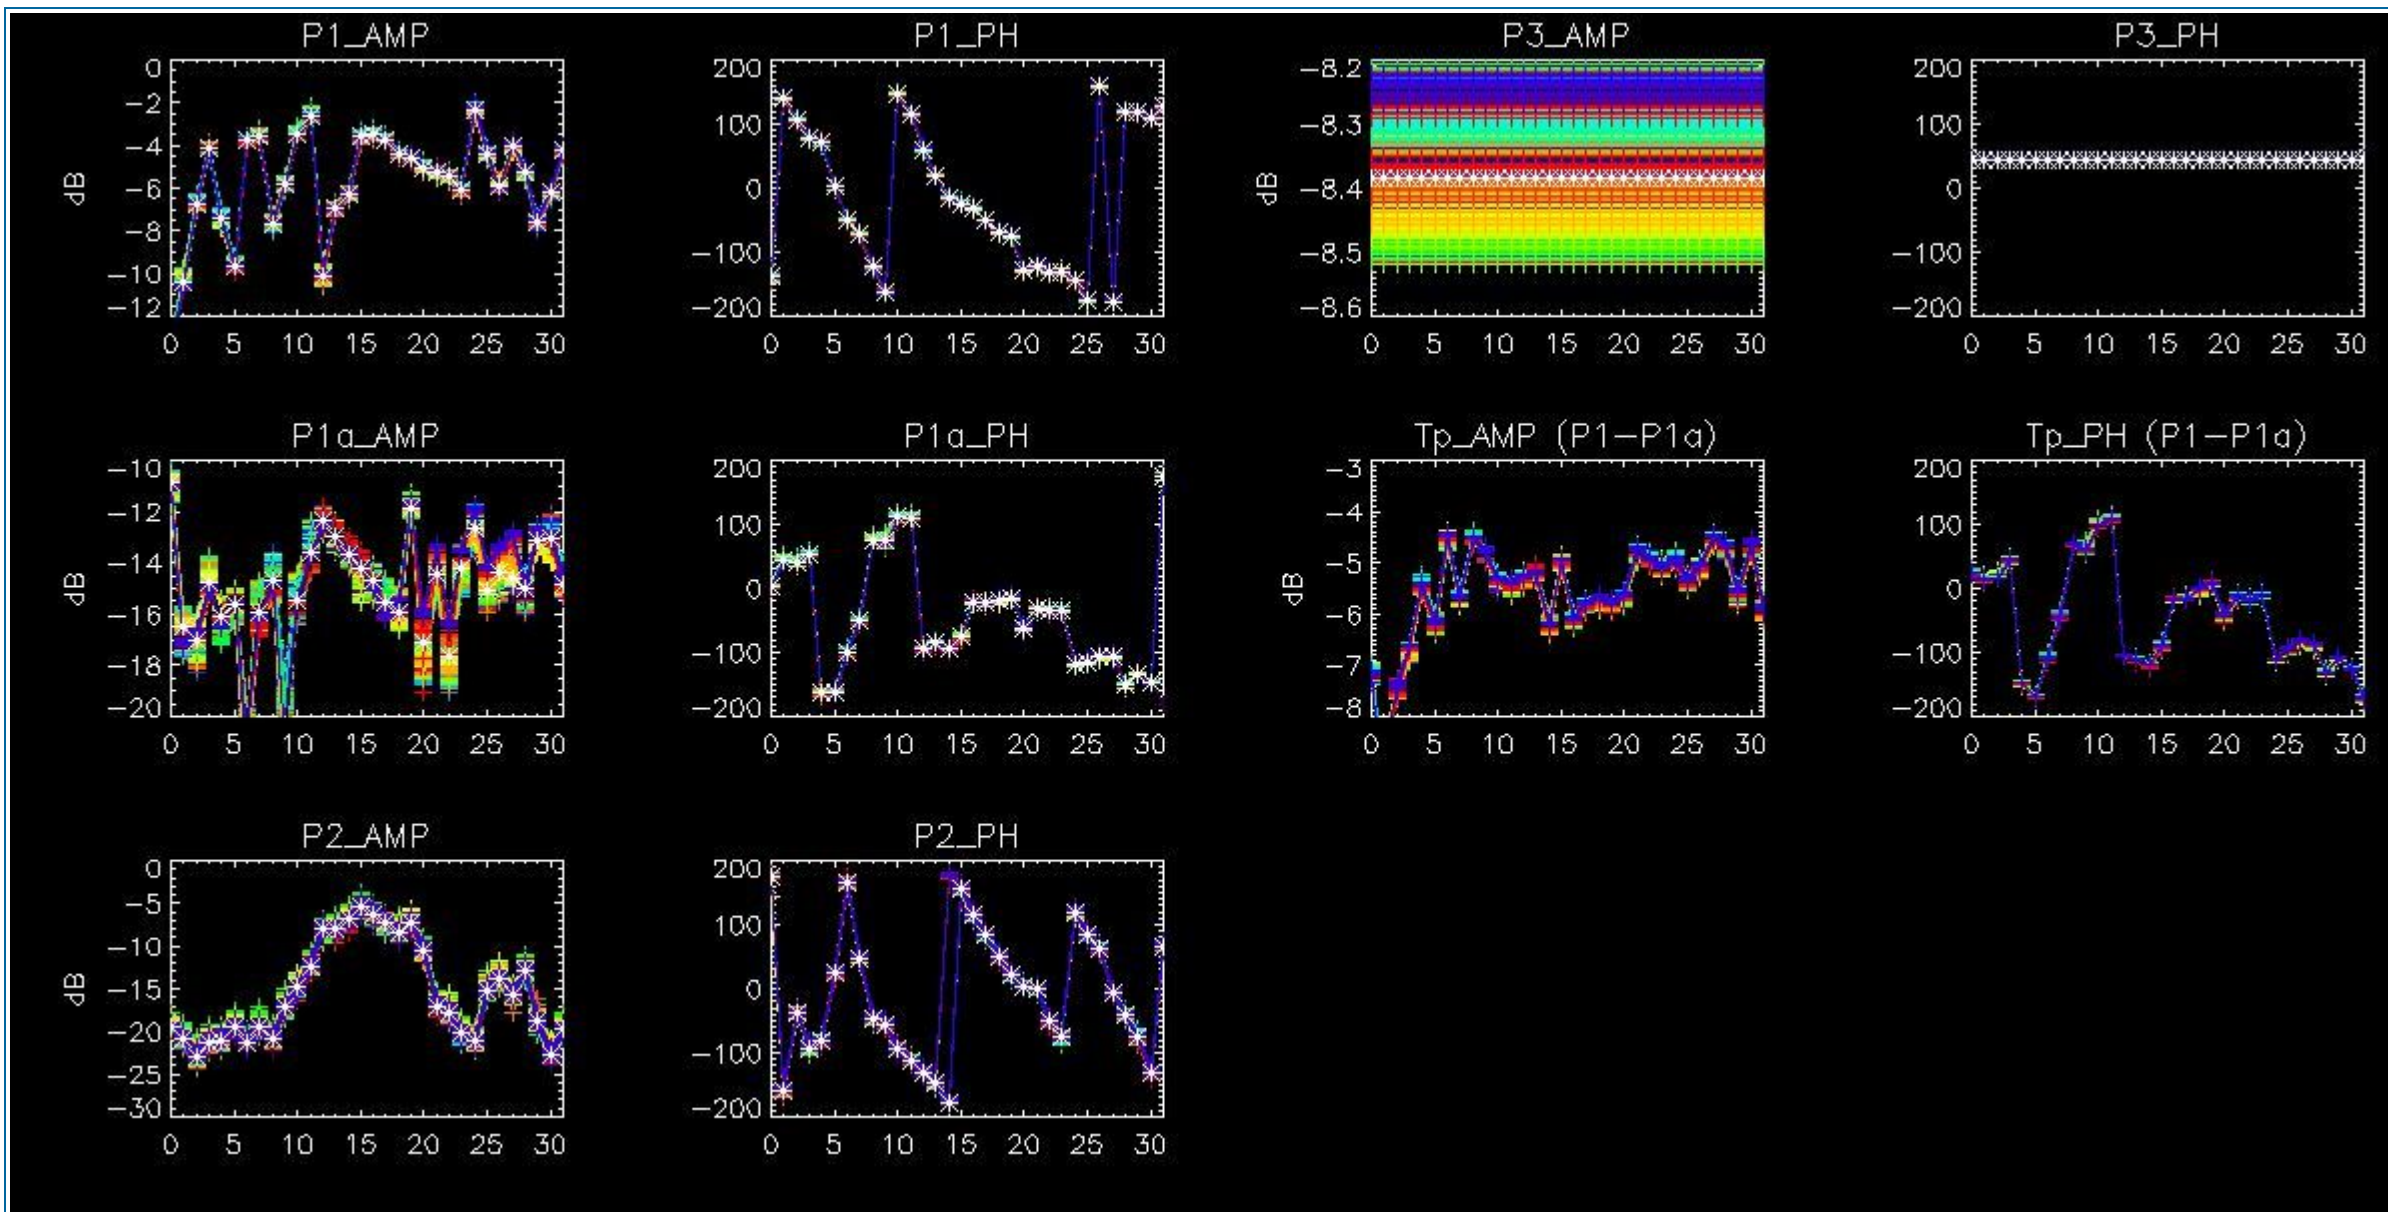

4.2 - Analysis for GM1 SS3 H/H


4.2.1 - Temporal Evolution Analysis for GM1 SS3 H/H

[BACK TO MENU]


Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Rows: [2/6/10/14/18/22/26/30] [3/7/11/15/19/23/27/31] [4/8/12/16/20/24/28/32]

Calibration pulses for GM1 SS3 H/H

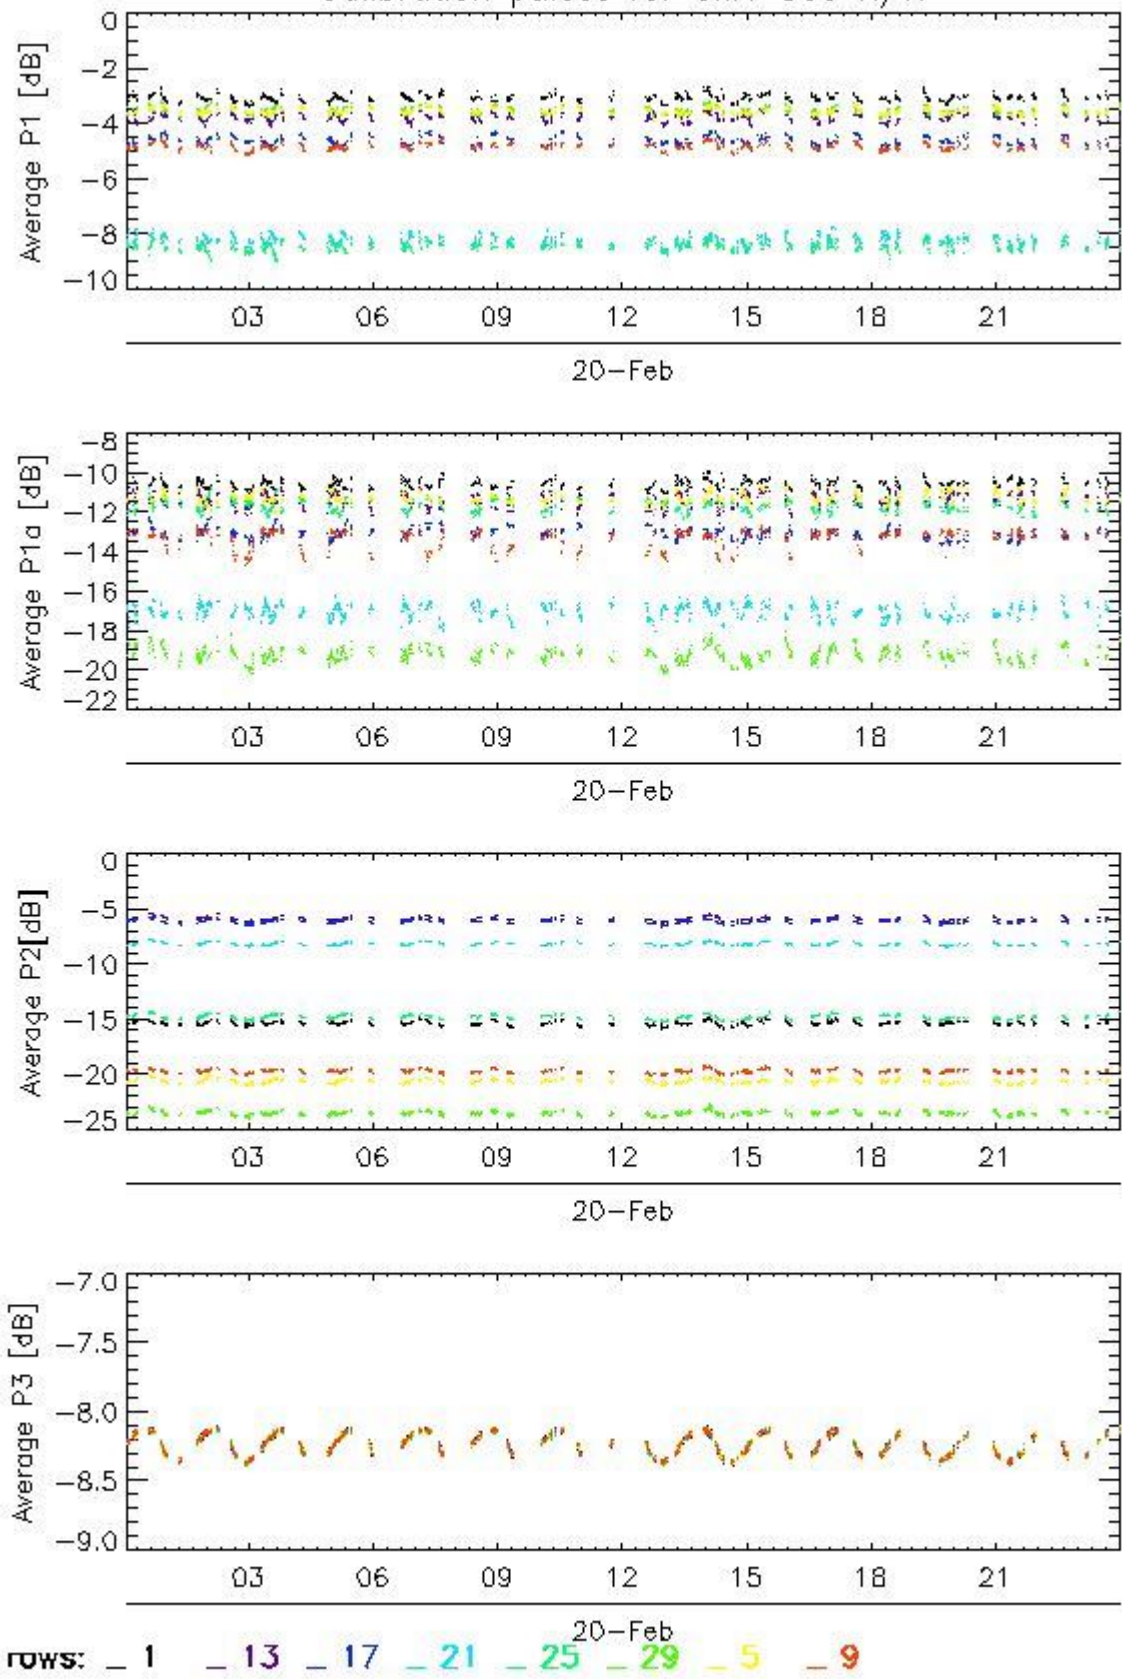


Transmit power (P1 - P1a) for GM1 SS3 H/H

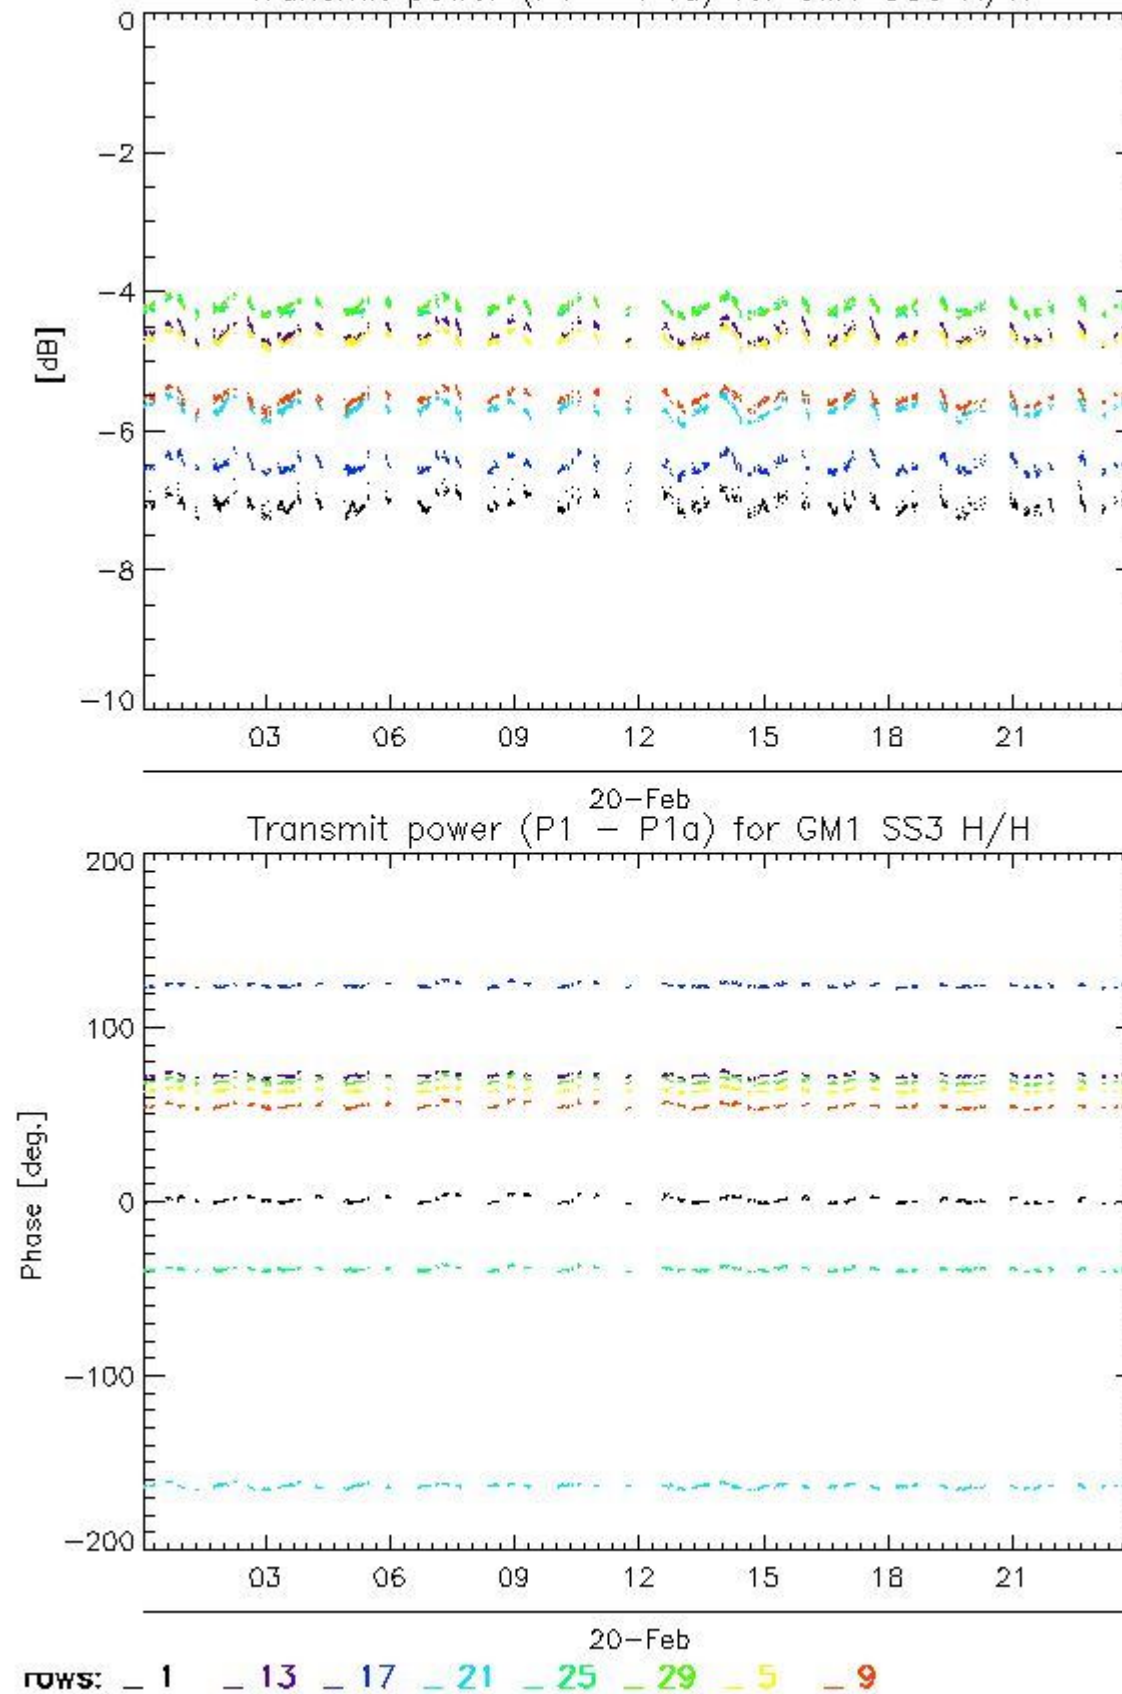

4.2.2 - All Rows Analysis for GM1 SS3 H/H

[[BACK TO MENU](#)]



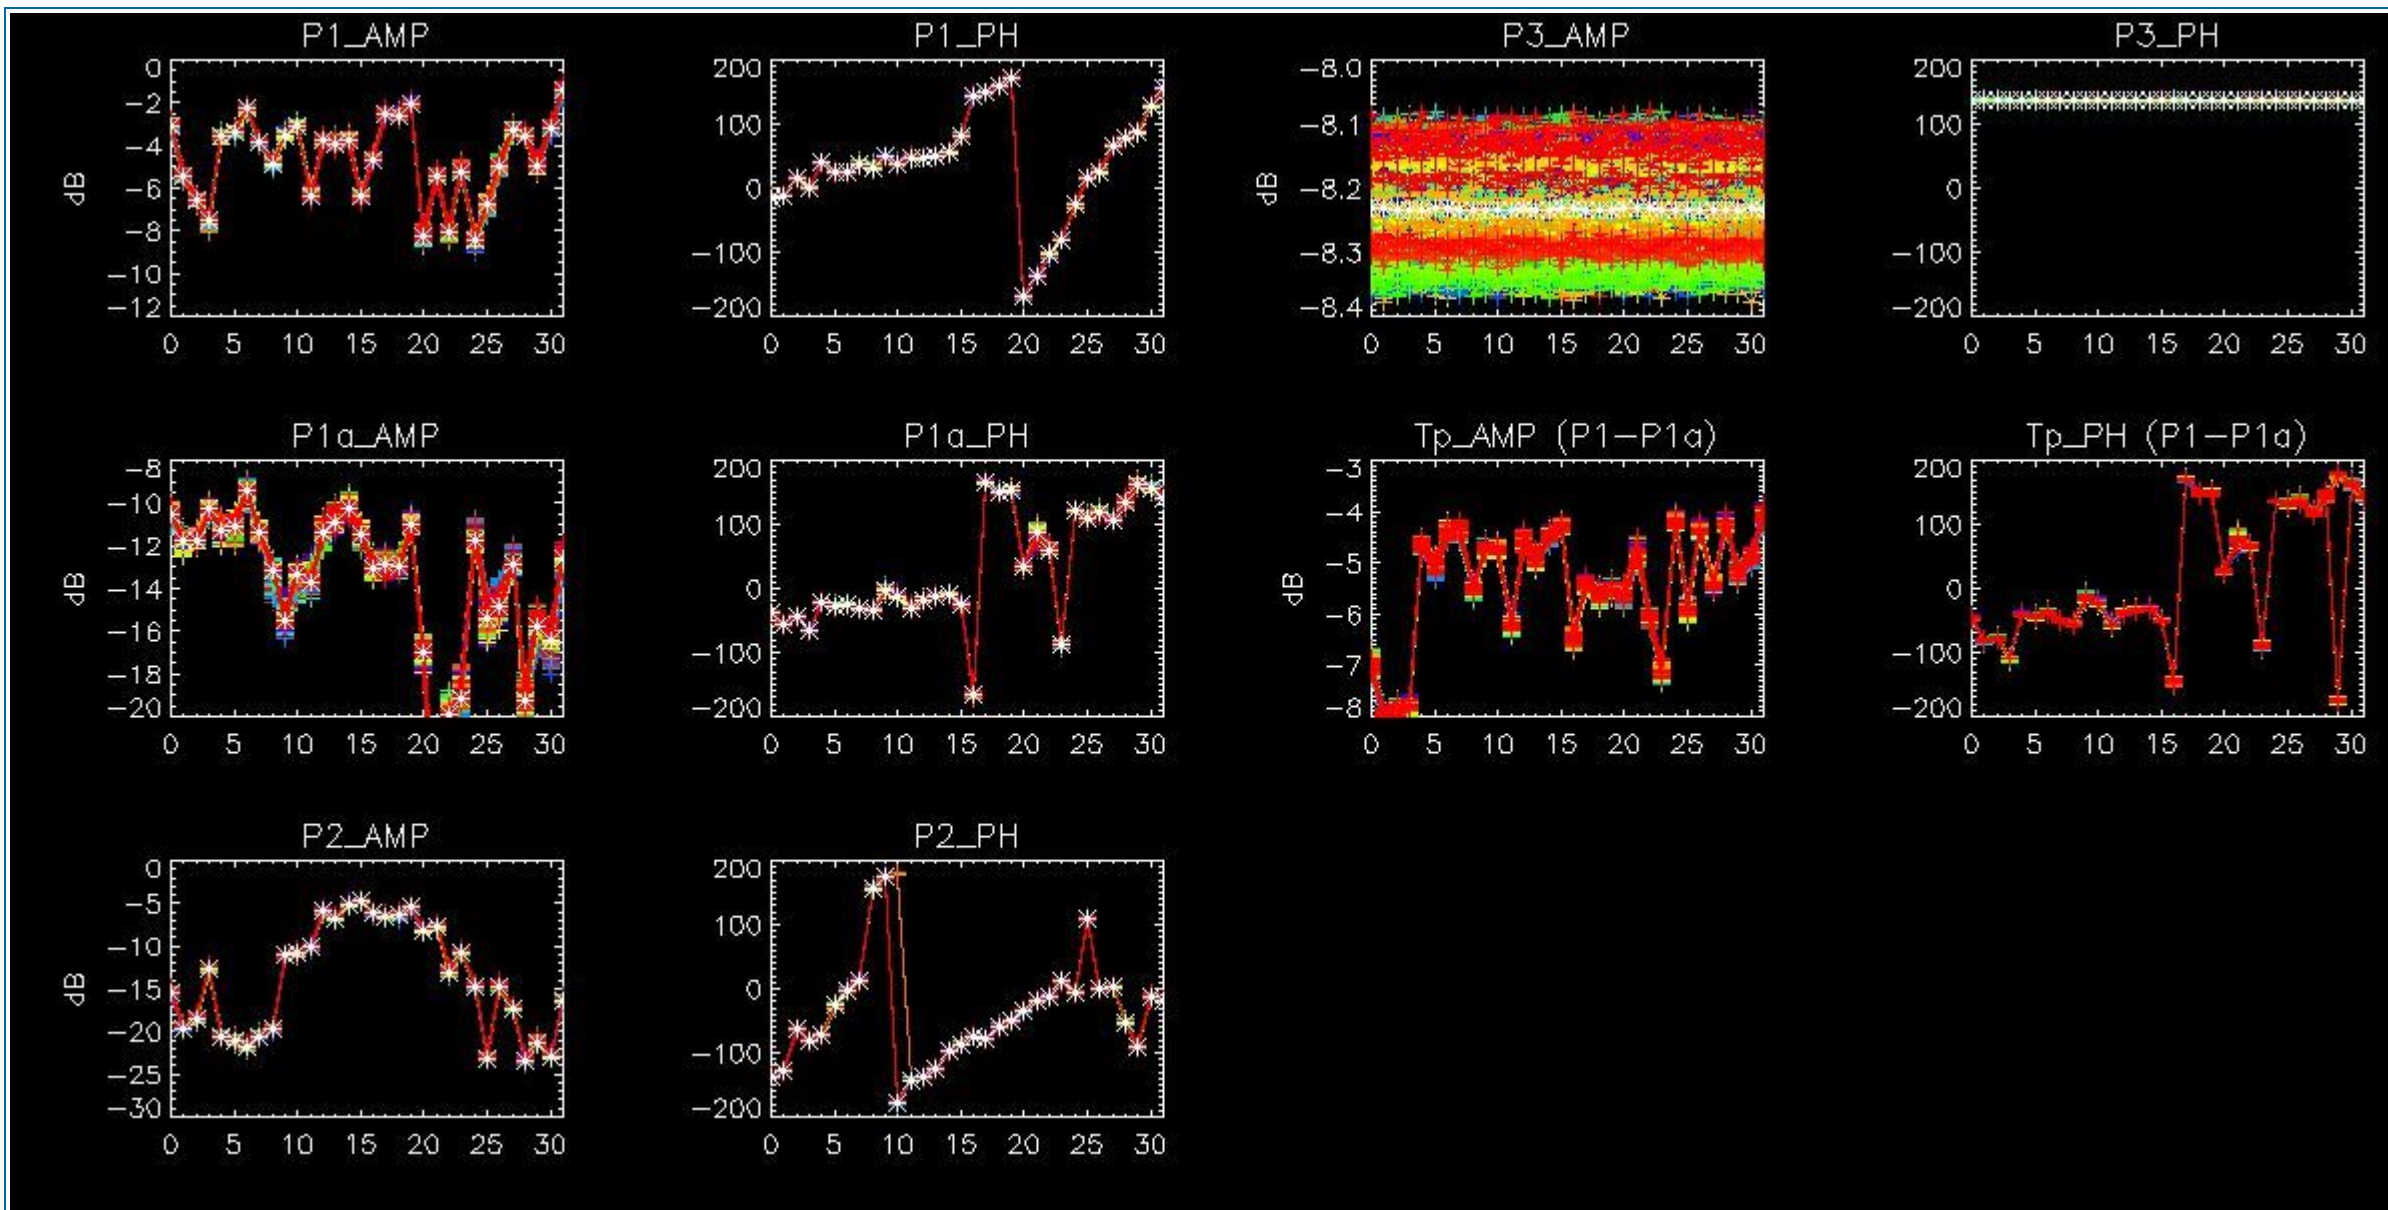


5 - DOPPLER ANALYSIS

5.1 - Analysis for WVS IS2 V/V

5.1.1 - Doppler MAP Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]




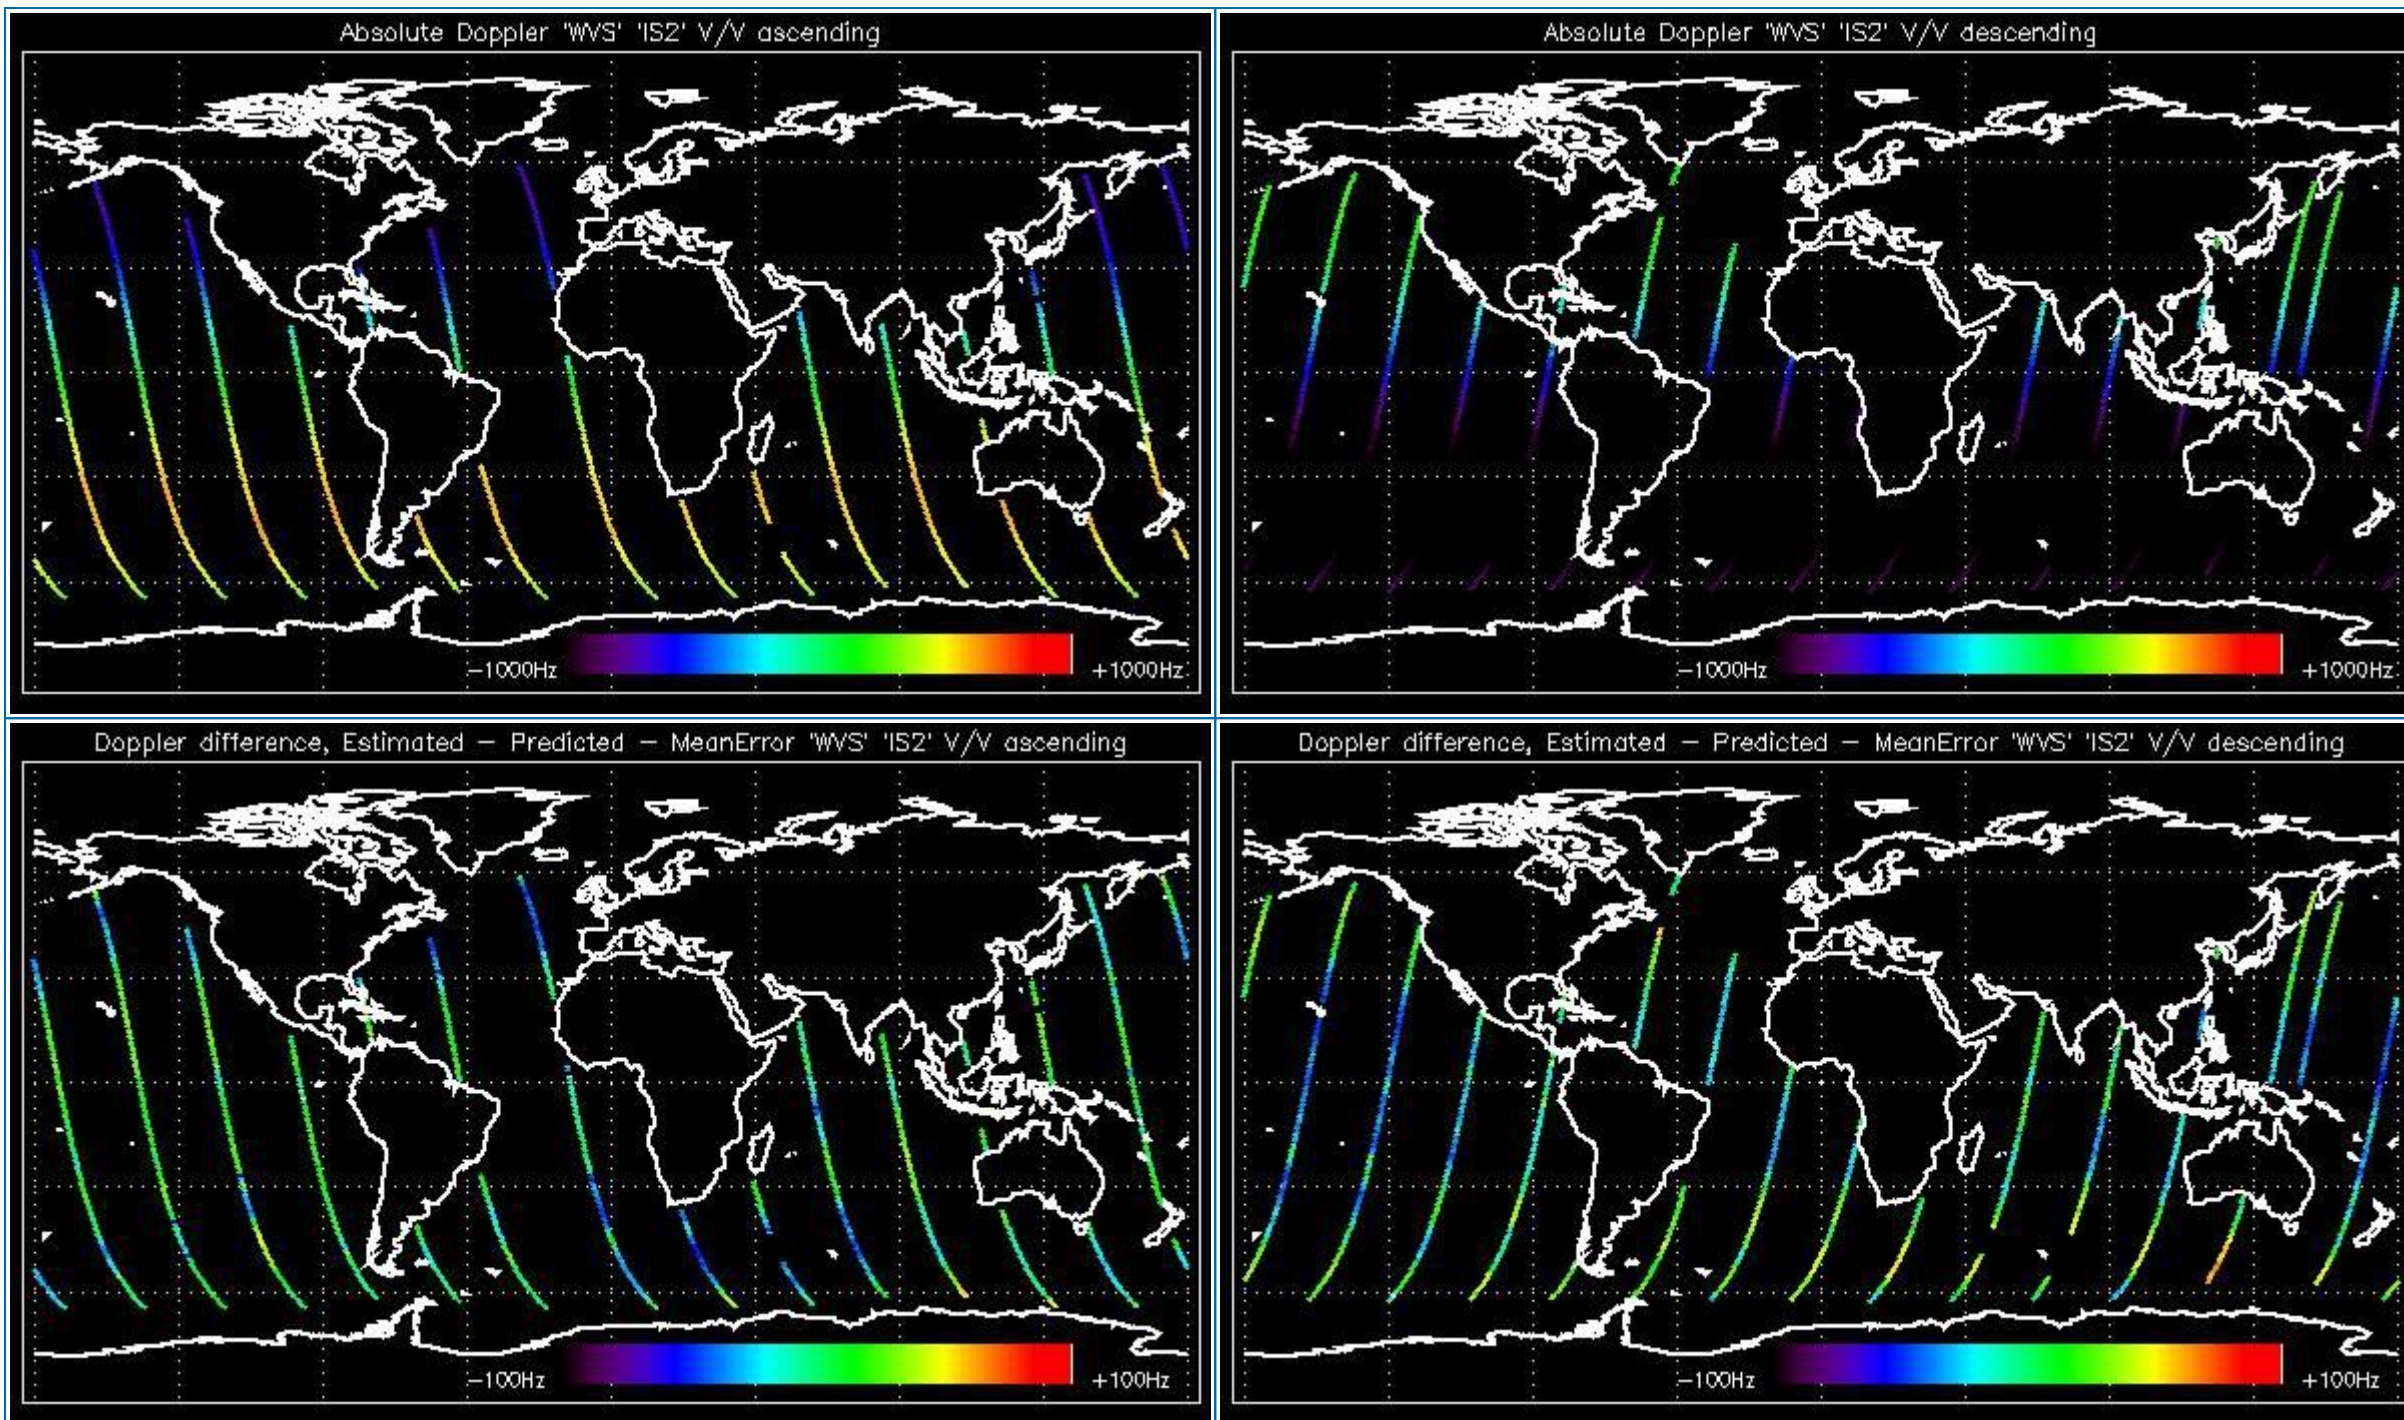

5.1.2 - Doppler ANX Analysis for WVS IS2 V/V

[[BACK TO MENU](#)]



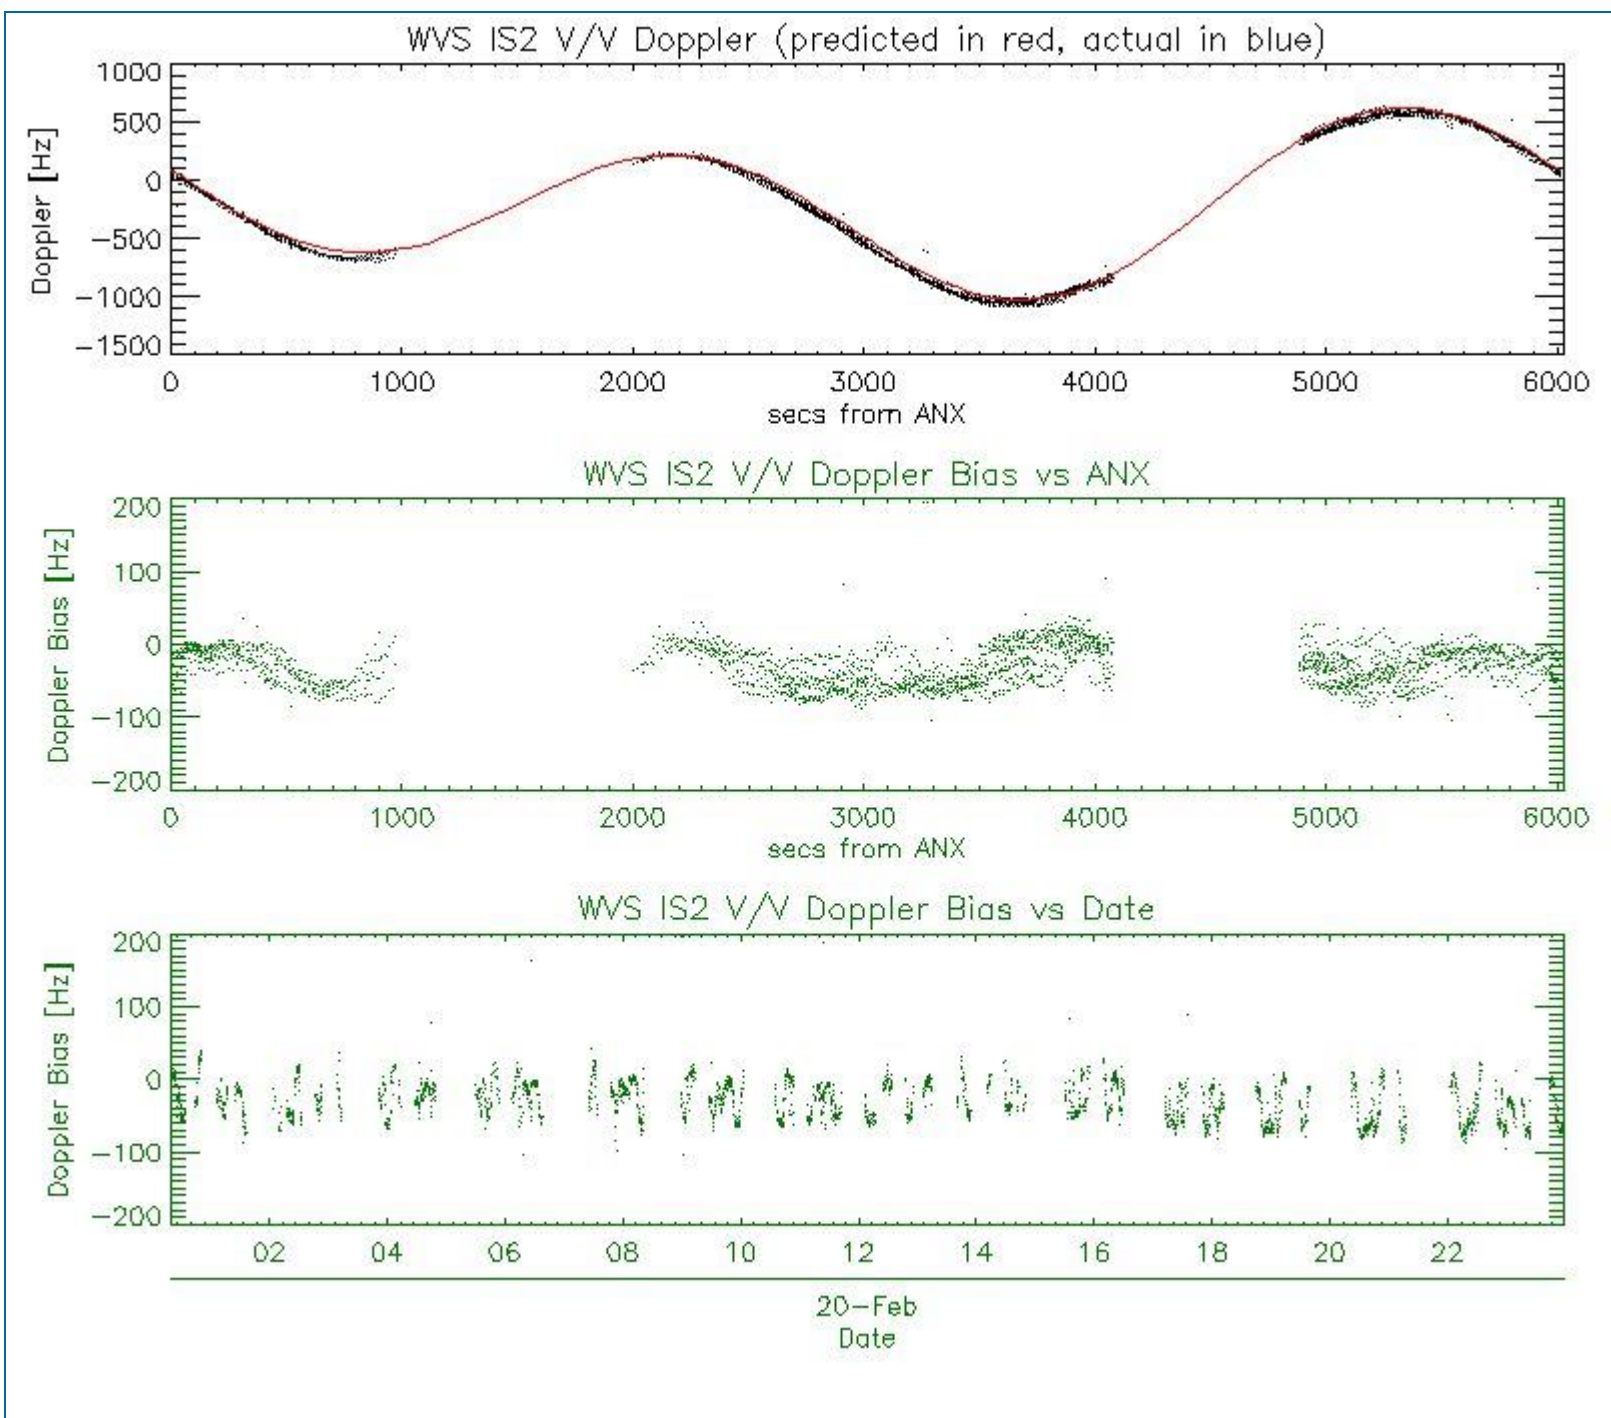


5.2 - Analysis for GM1 SS1 H/H

5.2.1 - Doppler MAP Analysis for GM1 SS1 H/H


[[BACK TO MENU](#)]




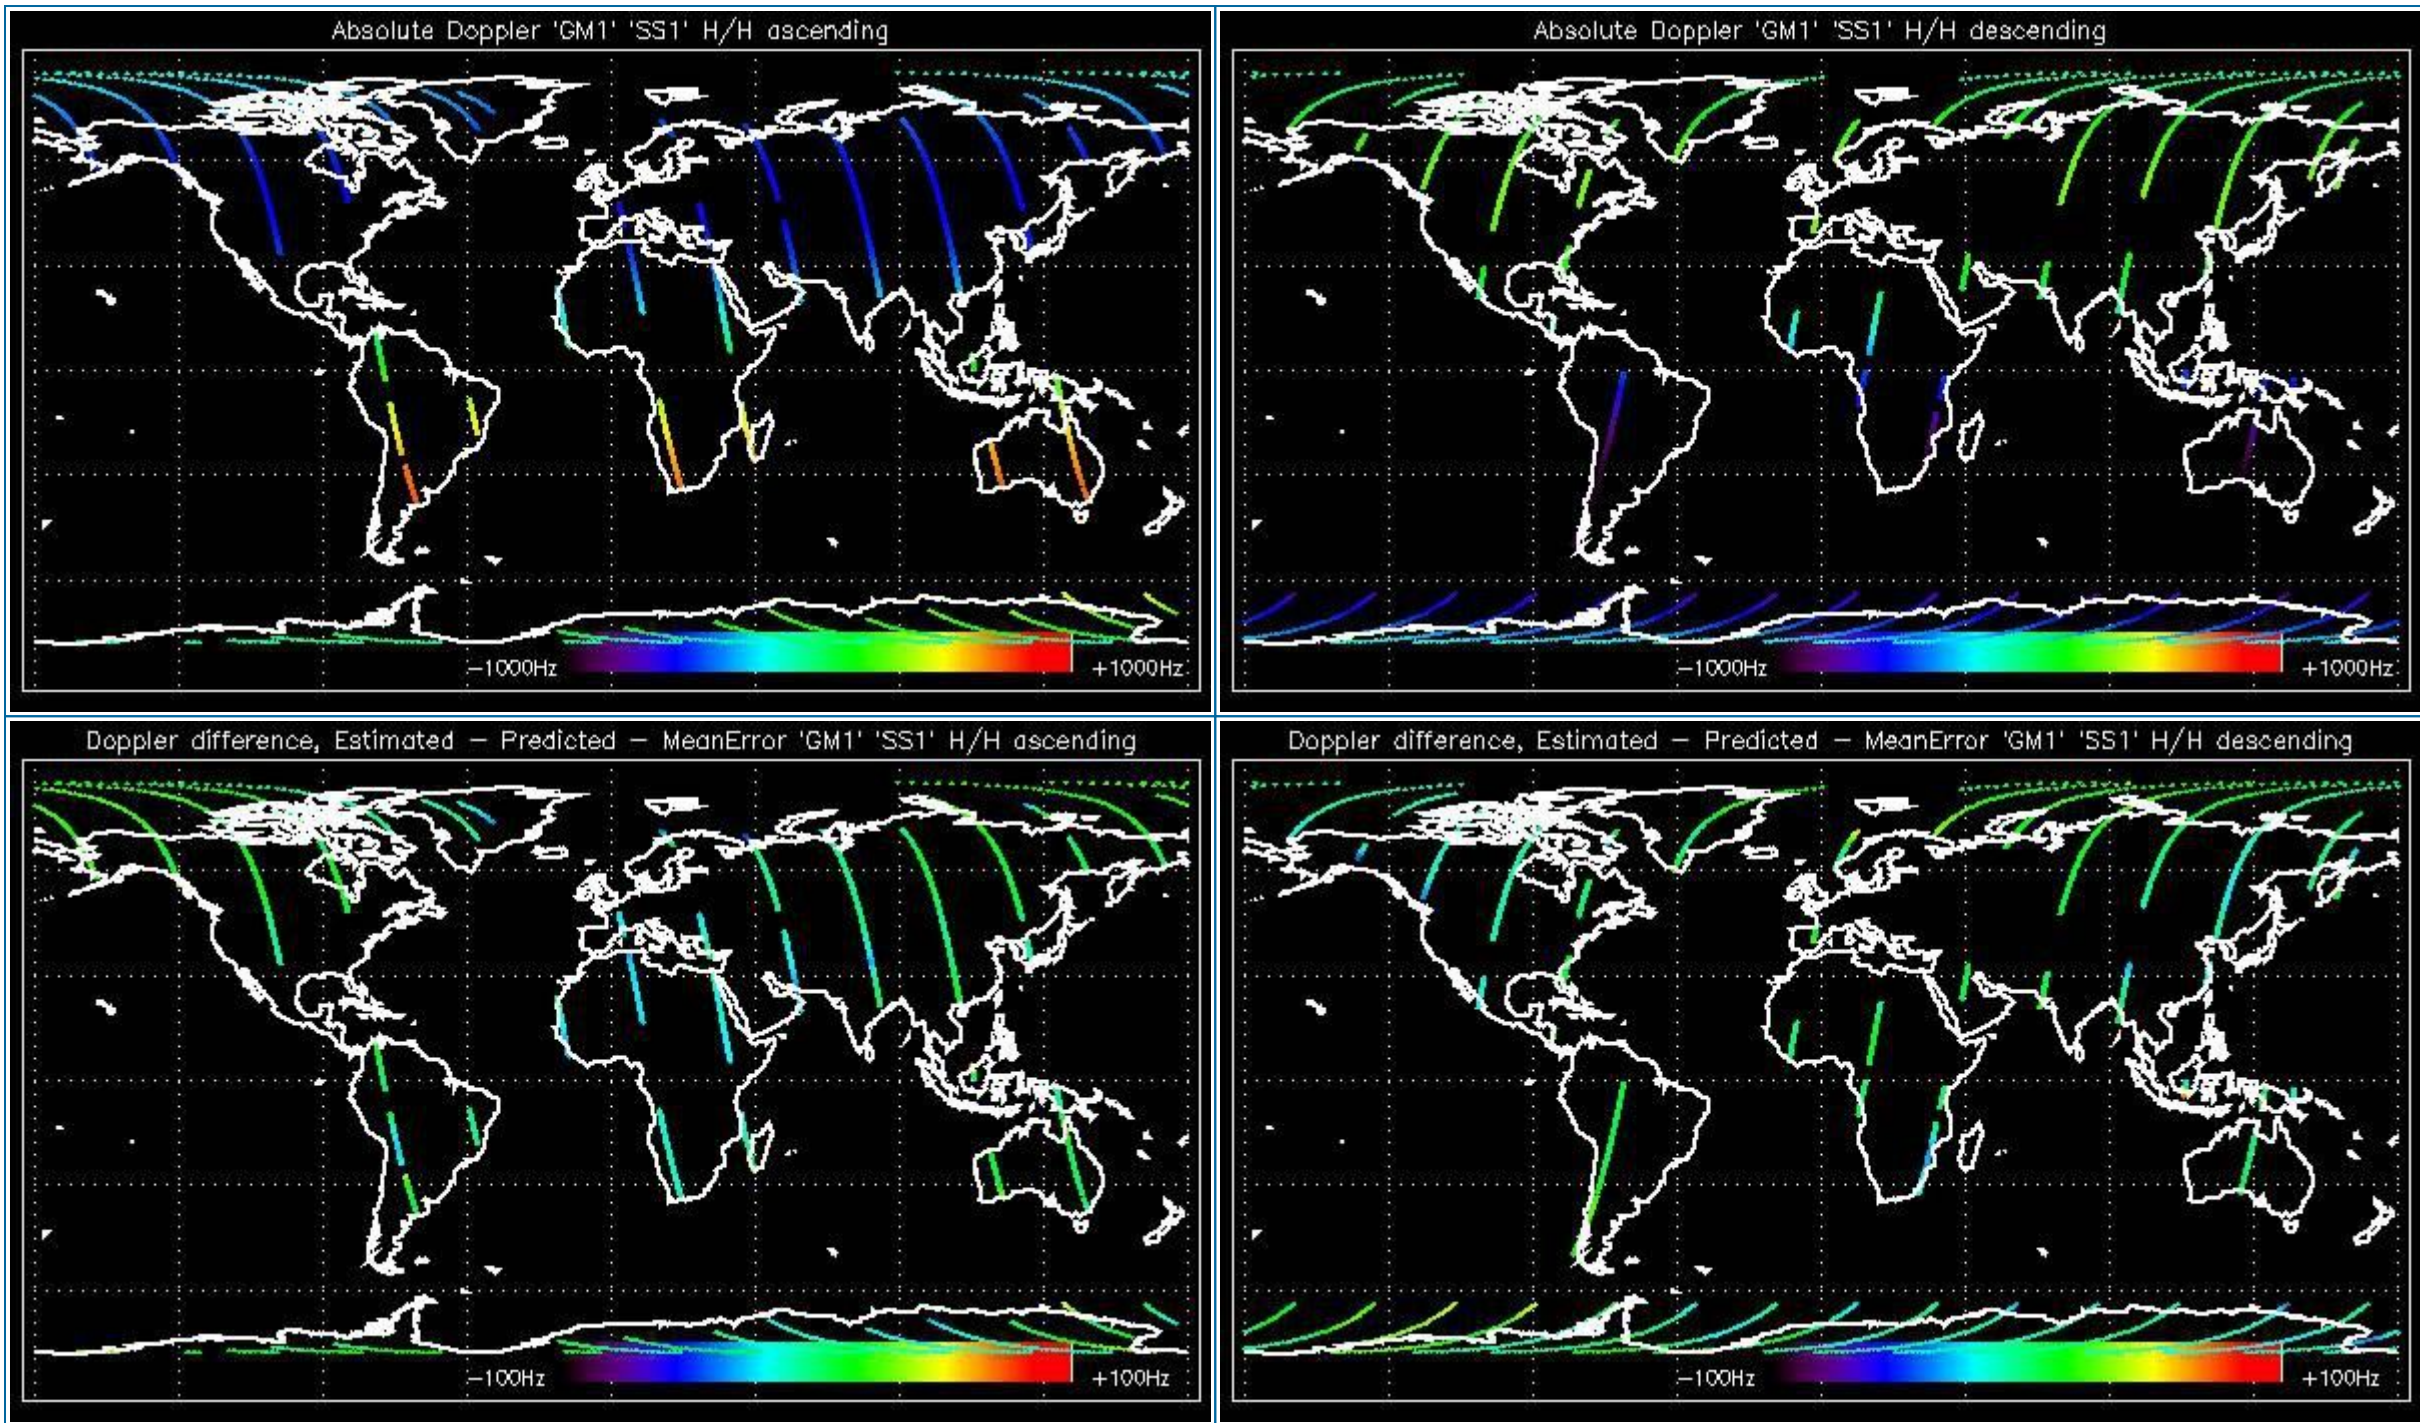

5.2.2 - Doppler ANX Analysis for GM1 SS1 H/H

[[BACK TO MENU](#)]




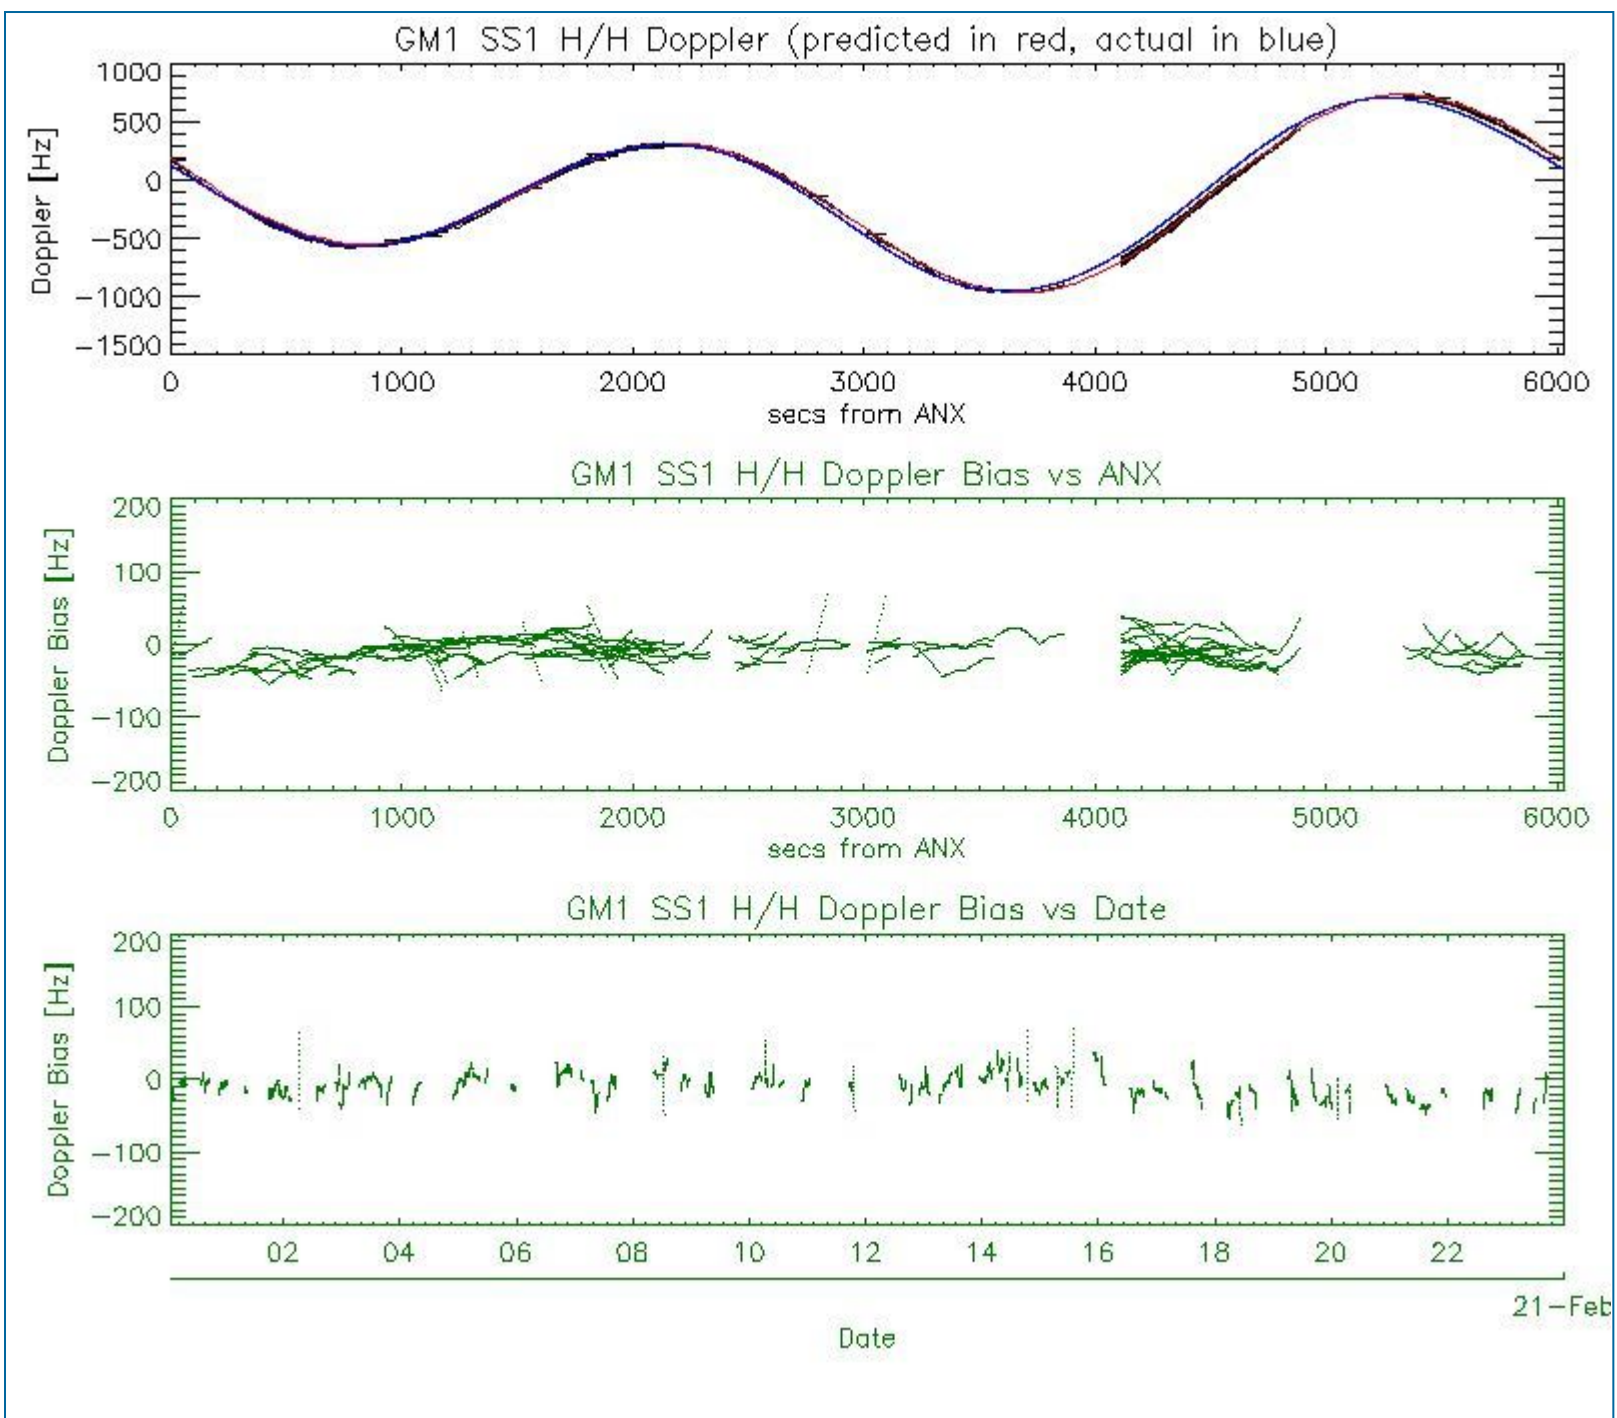

5.3 - Doppler JUMPS Analysis for WSM

[[BACK TO MENU](#)]



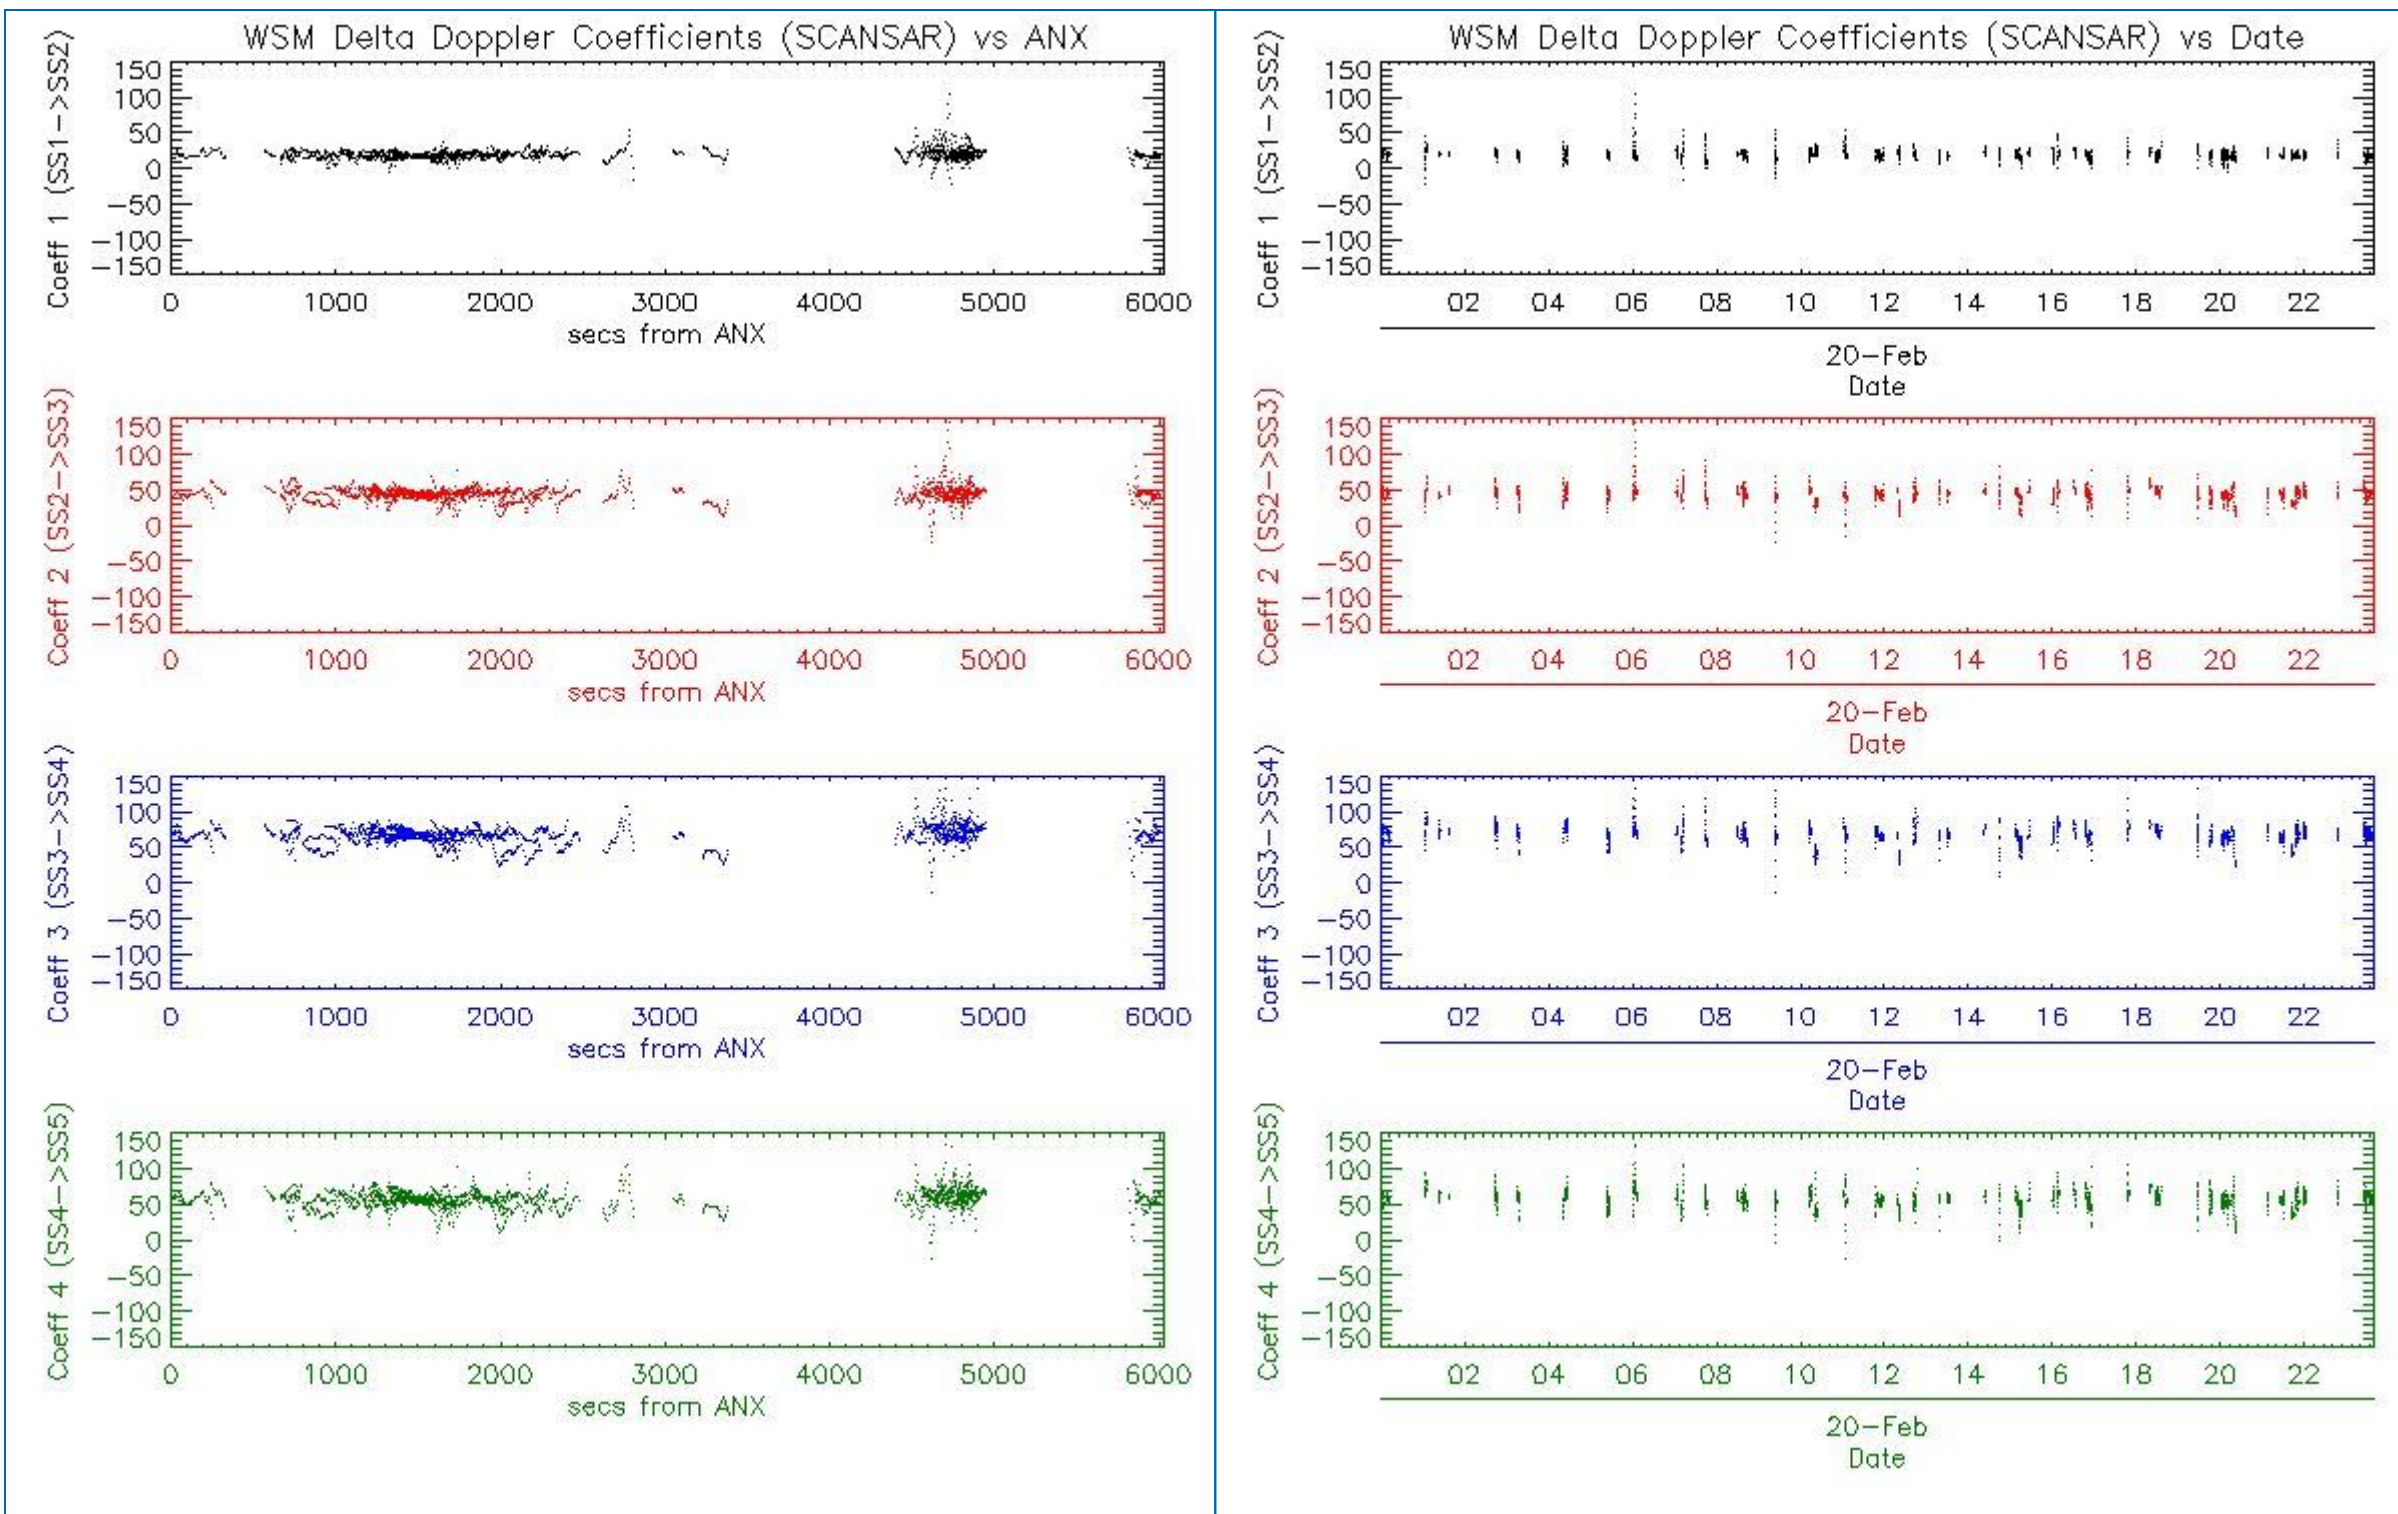



6 - CHIRP ANALYSIS

6.1 - Analysis for WSM SS1 H/H

6.1.1 - ScaleFactor

[[BACK TO MENU](#)]





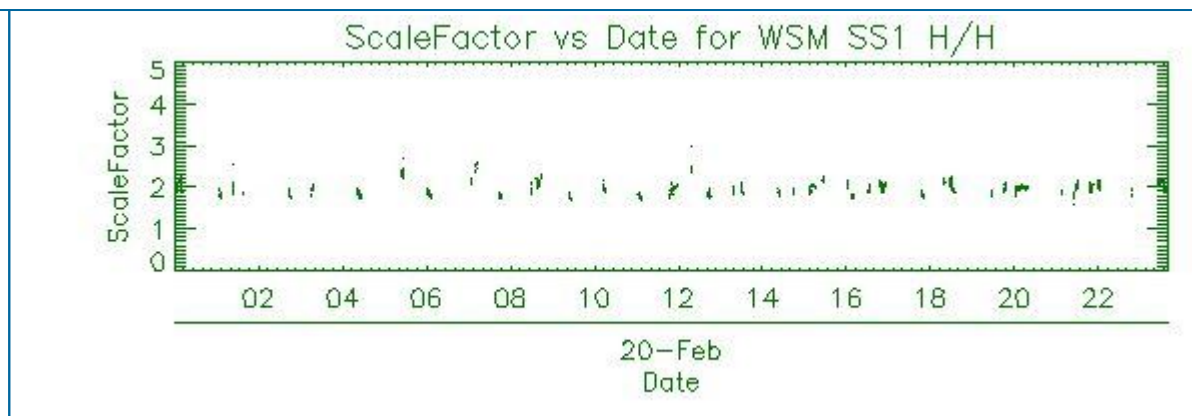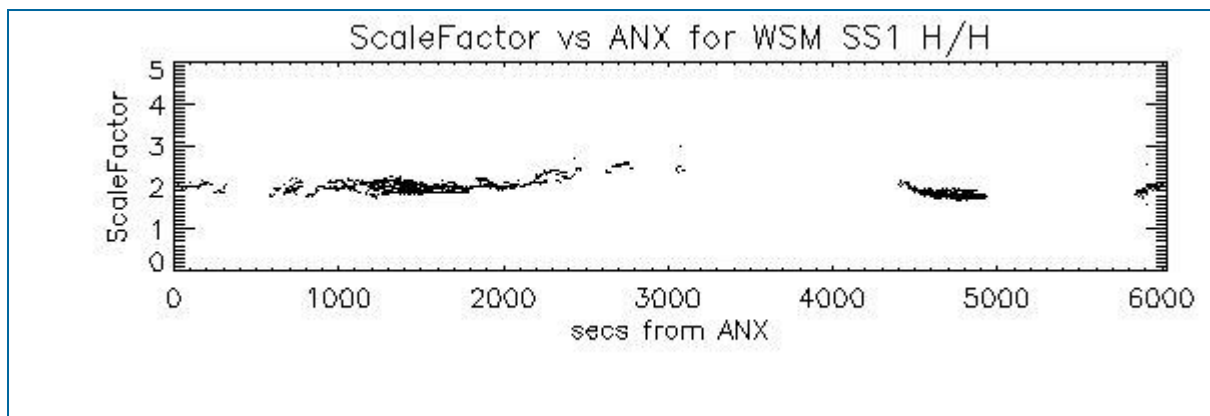

6.2 - Analysis for WSM SS1 V/V

6.2.1 - ScaleFactor

[[BACK TO MENU](#)]


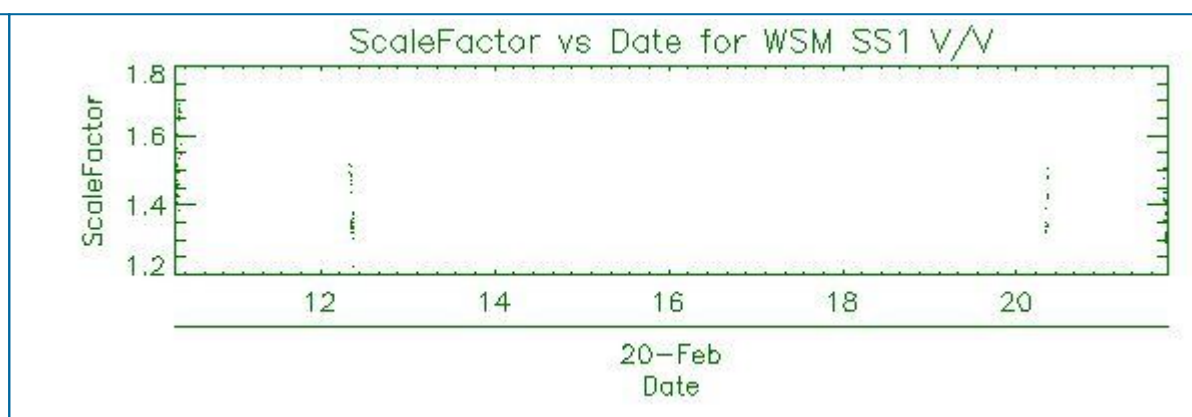
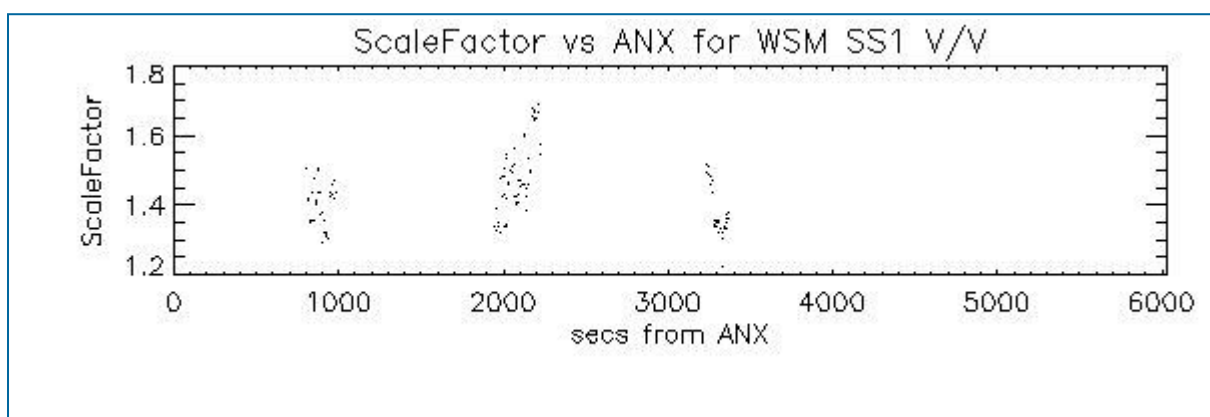


7 - RAW DATA ANALYSIS

7.1 - Analysis for WVS

[[BACK TO MENU](#)]


--	--	--

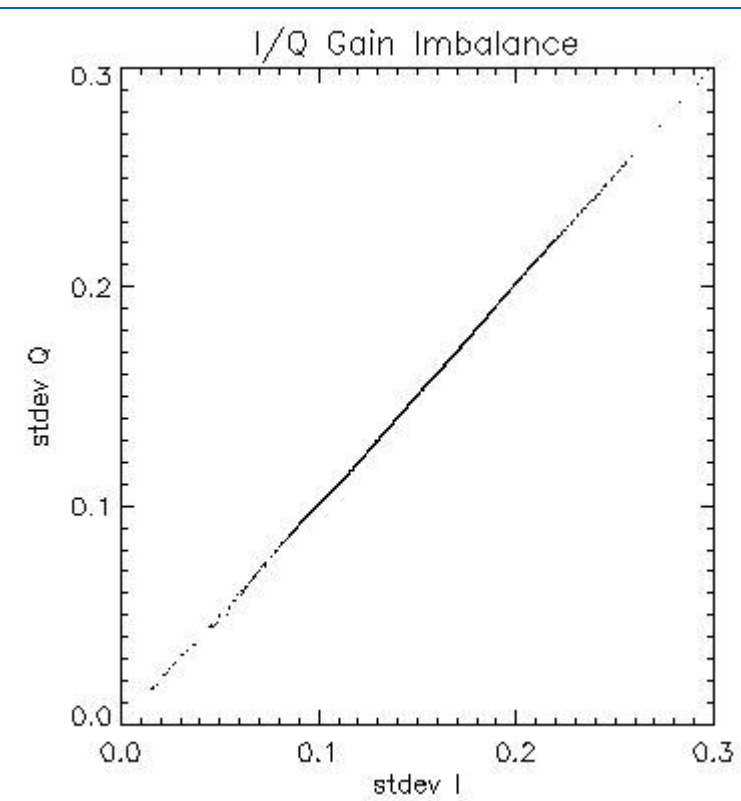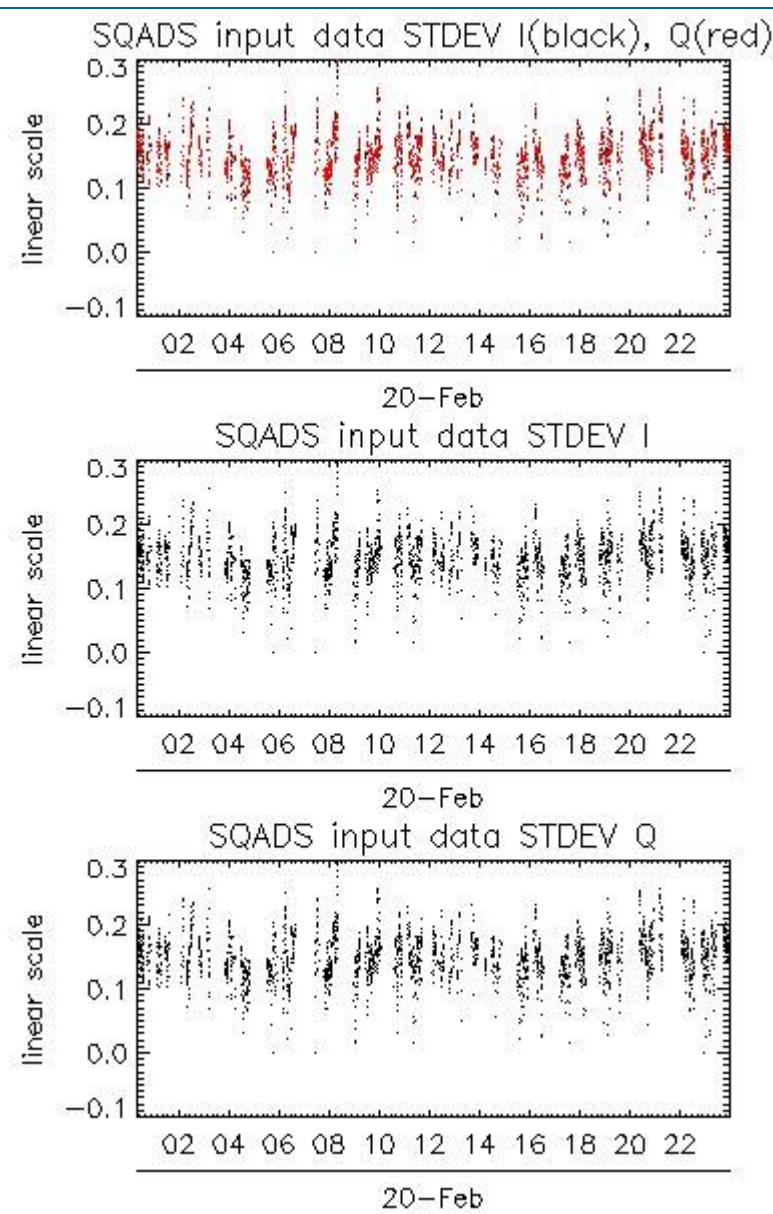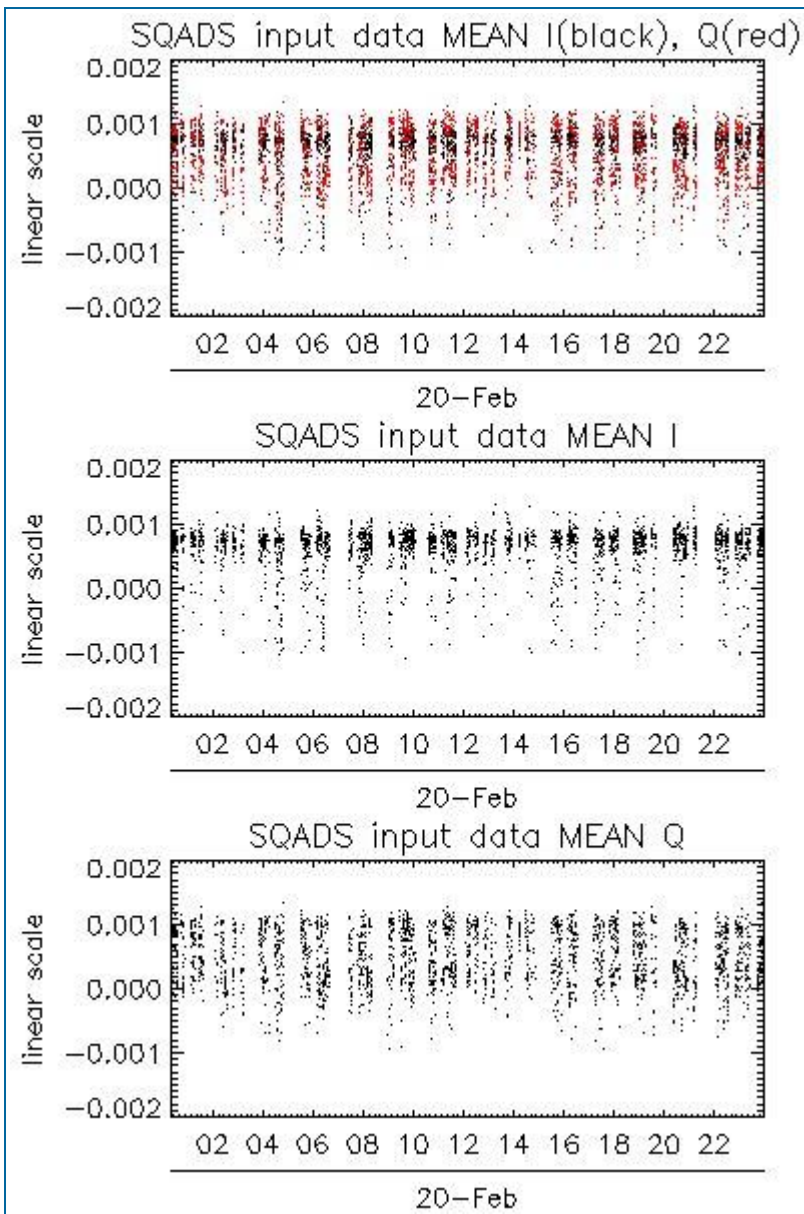


Channel	Statistics	DSS-B
MEAN I	mean	0.000612226
	stdev	1.37347e-07
MEAN Q	mean	0.000489001
	stdev	1.89233e-07
Channel	Statistics	DSS-B
STDEV I	mean	0.149217
	stdev	0.00128227
STDEV Q	mean	0.149764
	stdev	0.00130803

7.2 - Analysis for IMM

[[BACK TO MENU](#)]



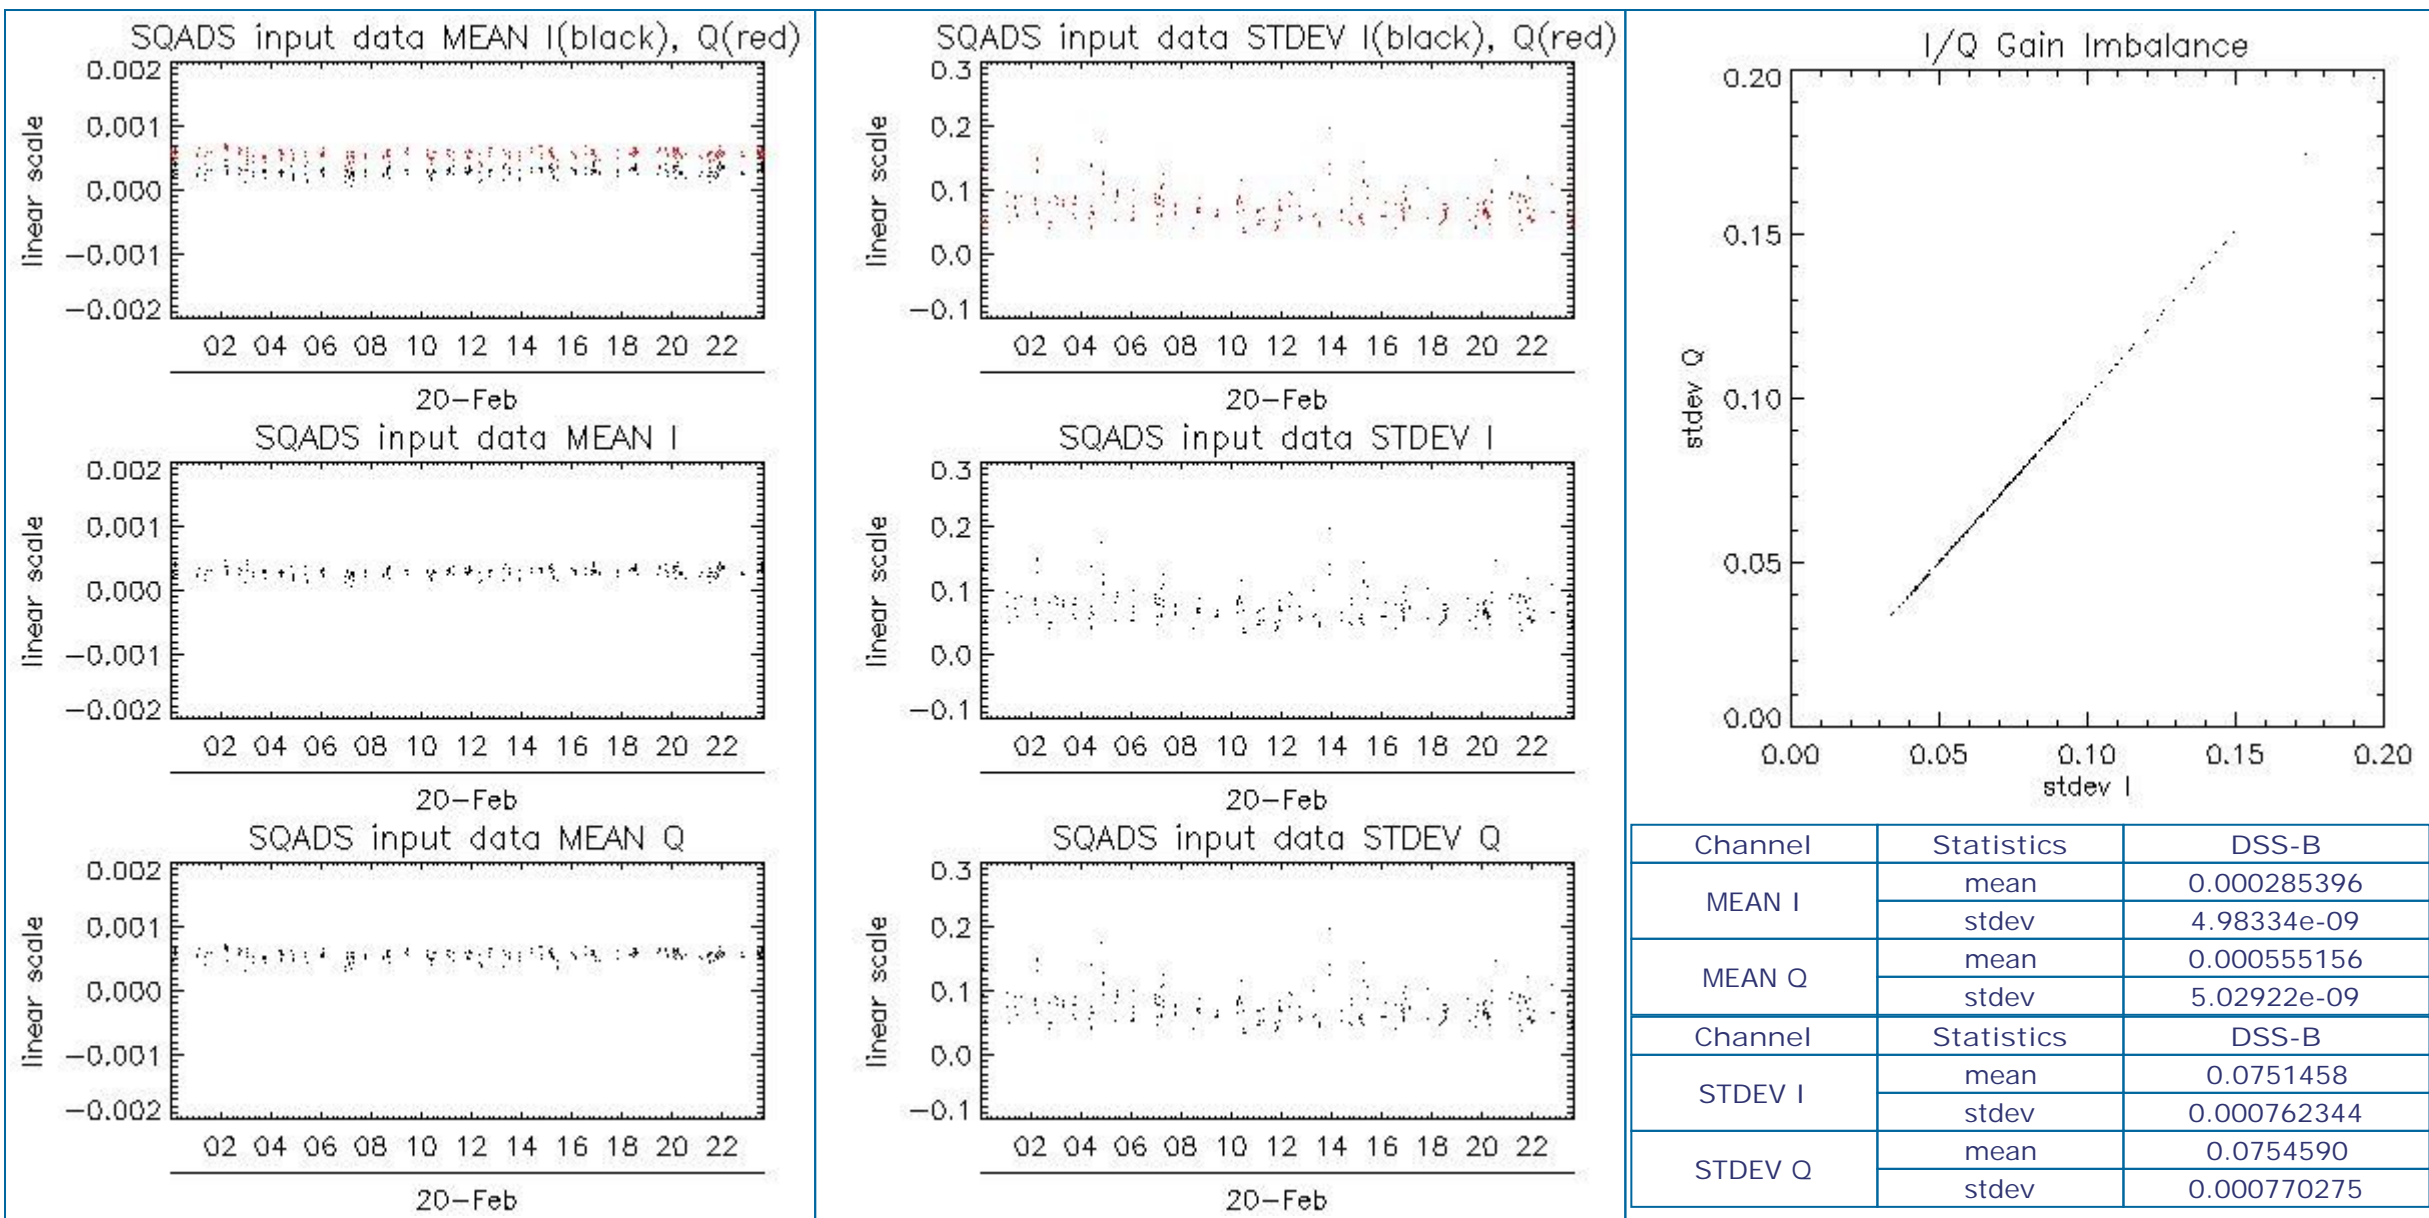



8 - TELEMETRY ANALYSIS

Processing Center	Product	Gaps	Missing lines
PDE	ASA_WVS_1PNPDE20120220_010620_000004353112_00002_52171_3316.N1	1	0
PDE	ASA_WVS_1PNPDE20120220_010620_000004353112_00002_52171_3318.N1	1	0
PDE	ASA_WVS_1PNPDE20120220_035053_000007343112_00004_52173_3360.N1	1	0
PDK	ASA_WVS_1PNPDK20120220_130609_000004983112_00009_52178_8975.N1	0	8
PDE	ASA_WSM_1PNPDE20120220_163113_000000923112_00012_52181_3593.N1	0	16
PDK	ASA_WSM_1PNPDK20120220_013704_000000613112_00003_52172_8791.N1	5	2443
PDK	ASA_WSM_1PNPDK20120220_115235_000003613112_00009_52178_8943.N1	0	1

8.1 - Number of Missing lines


[BACK TO MENU]



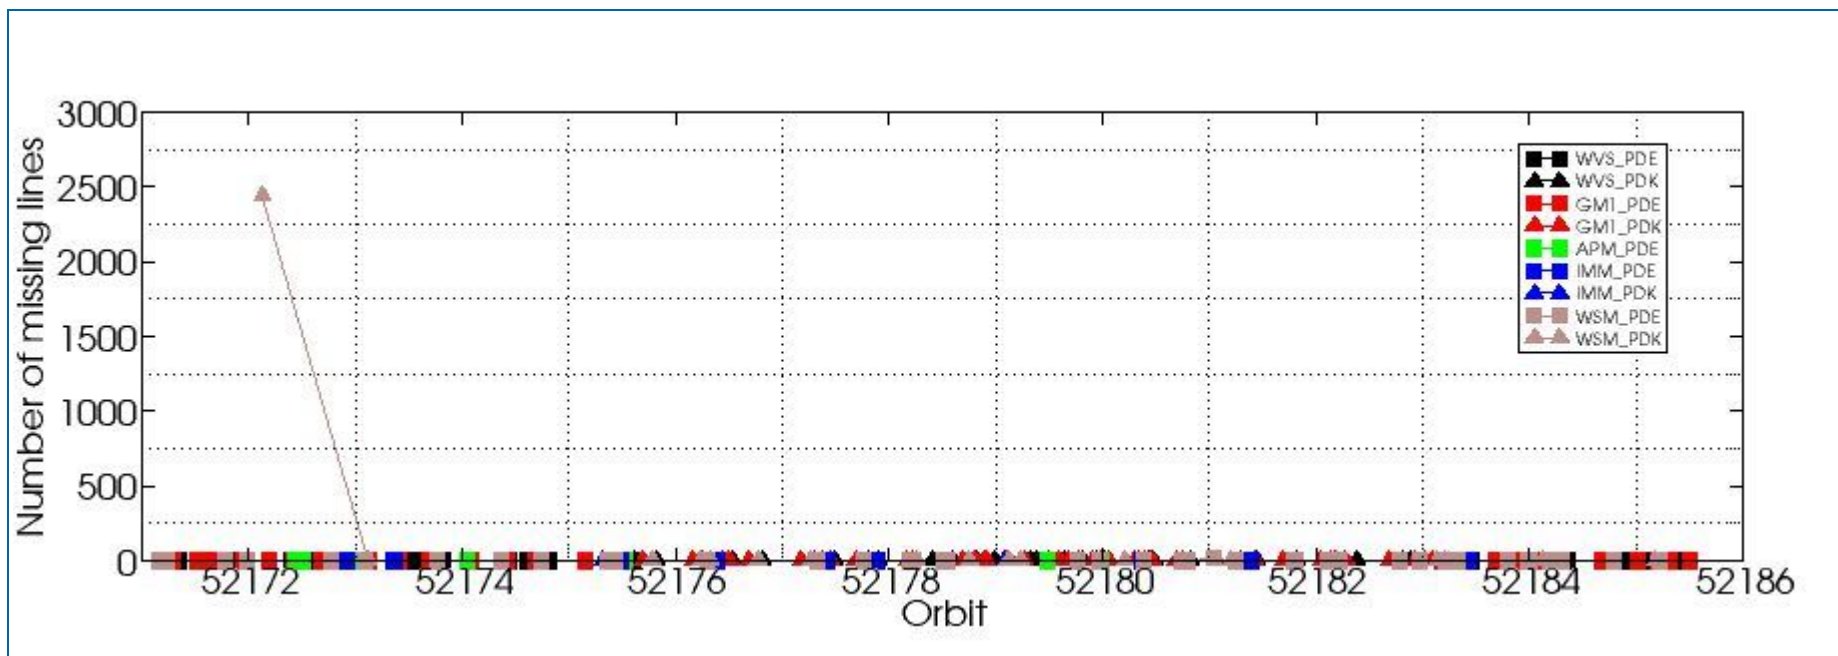

8.2 - Number of Gaps

[[BACK TO MENU](#)]

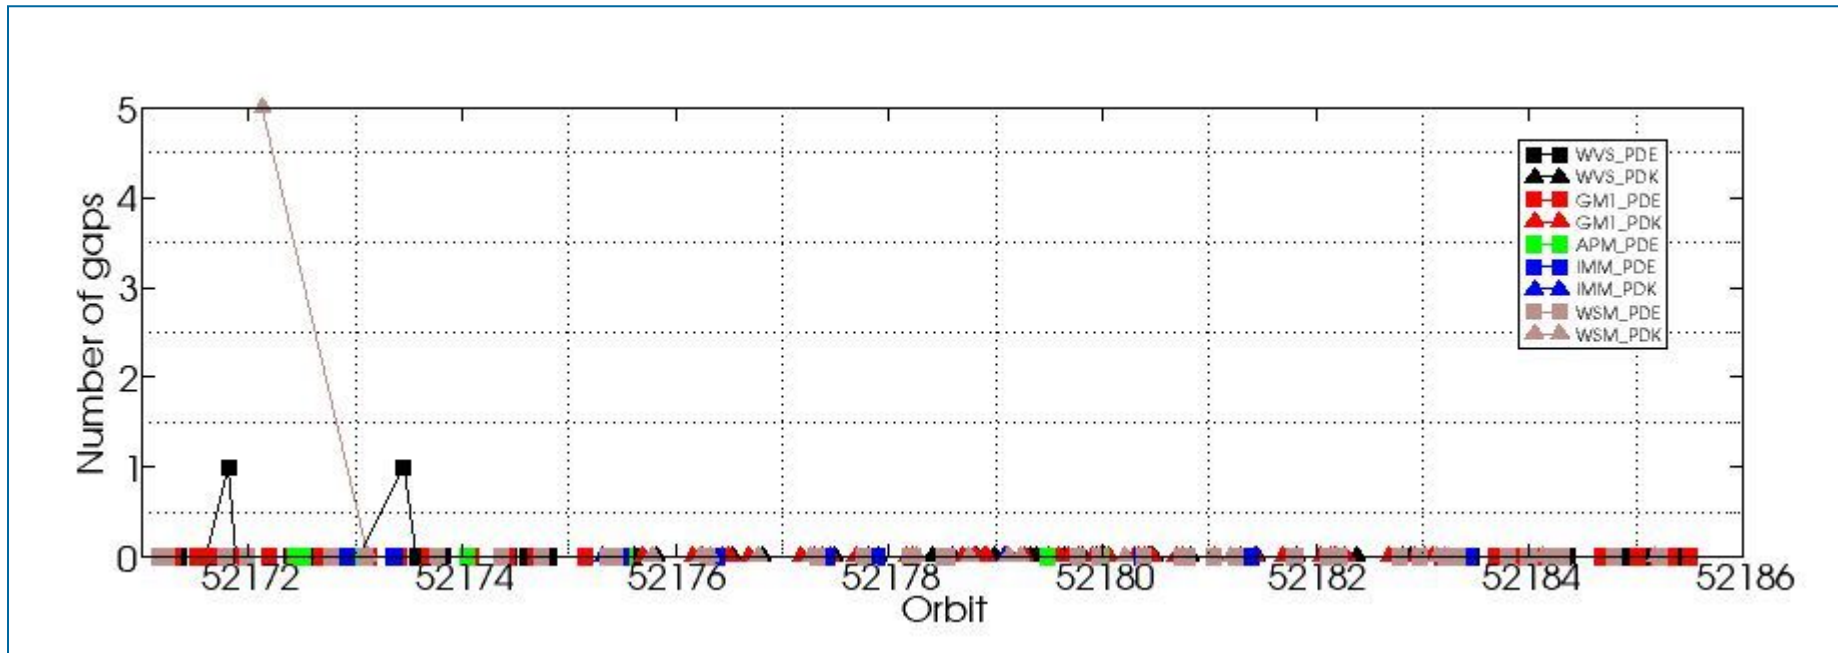

ASAR DAILY REPORT for 120220
#####

MODE: DAILY
ANALYSIS: ALL
DATE: 2012-02-20 00:00:00

Analysis will be performed from 2012-02-20 00:00:00 to 2012-02-20 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_120220/

DATA SUMMARY

Summary will be performed from 2012-02-20 00:00:00 to 2012-02-20 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_120220/DATA_SUMMARY

Creating directory ./RESULTS/DAILY/_120220/DATA_SUMMARY...
Writing file ./RESULTS/DAILY/_120220/DATA_SUMMARY/Data_summary.html...

Getting WVS products list from 2012-02-20 00:00:00 to 2012-02-20 23:59:59...
Writing file ./RESULTS/DAILY/_120220/DATA_SUMMARY/List_WVS_products_used.xls...
Writing file ./RESULTS/DAILY/_120220/DATA_SUMMARY/List_WVS_products_used.txt...

Getting GM1 products list from 2012-02-20 00:00:00 to 2012-02-20 23:59:59...
Writing file ./RESULTS/DAILY/_120220/DATA_SUMMARY/List_GM1_products_used.xls...
Writing file ./RESULTS/DAILY/_120220/DATA_SUMMARY/List_GM1_products_used.txt...

Getting APM products list from 2012-02-20 00:00:00 to 2012-02-20 23:59:59...
Writing file ./RESULTS/DAILY/_120220/DATA_SUMMARY/List_APM_products_used.xls...
Writing file ./RESULTS/DAILY/_120220/DATA_SUMMARY/List_APM_products_used.txt...

Getting IMM products list from 2012-02-20 00:00:00 to 2012-02-20 23:59:59...
Writing file ./RESULTS/DAILY/_120220/DATA_SUMMARY/List_IMM_products_used.xls...
Writing file ./RESULTS/DAILY/_120220/DATA_SUMMARY/List_IMM_products_used.txt...

Getting WSM products list from 2012-02-20 00:00:00 to 2012-02-20 23:59:59...
Writing file ./RESULTS/DAILY/_120220/DATA_SUMMARY/List_WSM_products_used.xls...
Writing file ./RESULTS/DAILY/_120220/DATA_SUMMARY/List_WSM_products_used.txt...

Getting MS products list from 2012-02-20 00:00:00 to 2012-02-20 23:59:59...
Writing file ./RESULTS/DAILY/_120220/DATA_SUMMARY/List_MS_products_used.xls...
Writing file ./RESULTS/DAILY/_120220/DATA_SUMMARY/List_MS_products_used.txt...

DATA SUMMARY completed
#####

AUXILIARY FILES ANALYSIS

Analysis will be performed from 2012-02-20 00:00:00 to 2012-02-20 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_120220/AUXILIARY

Creating directory ./RESULTS/DAILY/_120220/AUXILIARY...

Looking for the IECF operational ADFs list...



ADF filter 20120220*current_3_IECF_ADFs.txt
 Found list 20120220_030000_current_3_IECF_ADFs.txt...
 Extracting ADFs...

ASA_CON_AXVIEC20110526_075001_20101027_215740_20141231_000000
 ASA_INS_AXVIEC20110124_114858_20101228_112000_20141231_235959
 ASA_XCH_AXVIEC20101222_143057_20020301_000000_20141231_000000
 ASA_XCA_AXVIEC20120126_110323_20110607_000000_20141231_000000

Writing file ./RESULTS/DAILY/_120220/AUXILIARY/ASAR_ADFs_IECF_List3.html...
 Writing file ./RESULTS/DAILY/_120220/AUXILIARY/Auxiliary_files_summary.html...

Analysing WVS products...

Writing file ./RESULTS/DAILY/_120220/AUXILIARY/Check_ADFs_WVS.xls...
 Writing file ./RESULTS/DAILY/_120220/AUXILIARY/Check_ADFs_WVS.txt...

ASA_WVS_1PNPDE20120220_001942_000009143112_00002_52171_3313.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_004413_000004203112_00002_52171_3315.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_010620_000004353112_00002_52171_3316.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_010620_000004353112_00002_52171_3318.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_011235_000002853112_00002_52171_3343.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_012504_000006743112_00003_52172_3346.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_020405_00000593112_00003_52172_3356.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_020922_000001343112_00003_52172_3354.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_021752_000009003112_00003_52172_3353.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_024710_000003753112_00003_52172_3347.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_030822_000002993112_00004_52173_3362.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_035053_000007343112_00004_52173_3360.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_040253_000002853112_00004_52173_3402.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_041123_000001053112_00004_52173_3403.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_042741_000012743112_00004_52173_3409.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_053004_000010043112_00005_52174_3408.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_054618_000000603112_00005_52174_3447.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_054942_000002253112_00005_52174_3448.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_060702_000018443112_00005_52174_3453.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_072517_000001653112_00006_52175_3455.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_202142_000005693112_00014_52183_3623.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_203244_000013643112_00014_52183_3626.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_210913_000000753112_00014_52183_3627.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_210913_000000753112_00014_52183_3629.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_210958_000004353112_00014_52183_3657.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_220303_000018743112_00015_52184_3661.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_224921_000005243112_00015_52184_3660.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_225706_000007193112_00015_52184_3672.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_231437_000005843112_00016_52185_3675.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDE20120220_234343_000008693112_00016_52185_3678.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_072732_000003753112_00006_52175_8847.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_074716_000020393112_00006_52175_8850.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_085906_000008853112_00007_52176_8886.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_092730_000020993112_00007_52176_8891.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_103505_000011393112_00008_52177_8932.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_110743_000003453112_00008_52177_8931.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_111621_000015443112_00008_52177_8933.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_120621_000006143112_00009_52178_8966.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_122505_000005553112_00009_52178_8969.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_124806_000004203112_00009_52178_8971.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_130609_000004983112_00009_52178_8975.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_134007_000000903112_00010_52179_8999.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_134427_000005693112_00010_52179_9002.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_141114_000001953112_00010_52179_9004.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_142820_000004803112_00010_52179_9009.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_144105_000001043112_00010_52179_9007.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_144812_000001043112_00011_52180_9011.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_153007_000001193112_00011_52180_9032.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

```
ASA_WVS_1PNPDK20120220_153431_000012143112_00011_52180_9035.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_160923_000012743112_00011_52180_9037.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_171141_000014093112_00012_52181_9064.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_174942_000013343112_00012_52181_9067.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_184500_000018143112_00013_52182_9087.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_192914_000002103112_00013_52182_9086.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WVS_1PNPDK20120220_193517_000002403112_00013_52182_9091.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

Analysing GM1 products...

Writing file ./RESULTS/DAILY/_120220/AUXILIARY/Check_ADFs_GM1.xls...

Writing file ./RESULTS/DAILY/_120220/AUXILIARY/Check_ADFs_GM1.txt...

```
ASA_GM1_1PNPDE20120220_000406_000001993112_00002_52171_3309.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_001321_000003803112_00002_52171_3311.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_003539_000001083112_00002_52171_3312.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_003827_000003443112_00002_52171_3314.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_005329_000005673112_00002_52171_3317.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_005329_000005673112_00002_52171_3319.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_011941_000001693112_00002_52171_3342.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_014411_000011903112_00003_52172_3358.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_020551_000001083112_00003_52172_3357.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_021518_000000843112_00003_52172_3355.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_023341_000005433112_00003_52172_3352.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_025402_000000963112_00003_52172_3351.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_025552_000000903112_00003_52172_3350.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_025816_000002473112_00003_52172_3349.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_030413_000002473112_00003_52172_3348.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_031835_000013843112_00004_52173_3359.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_034609_000002833112_00004_52173_3361.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_041356_000004283112_00004_52173_3404.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_045437_000016683112_00005_52174_3406.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_052705_000001753112_00005_52174_3407.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_055412_000003503112_00005_52174_3449.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_064111_0000009673112_00006_52175_3450.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_070645_000001633112_00006_52175_3451.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_071634_000001023112_00006_52175_3452.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_071925_000003503112_00006_52175_3456.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_200615_000000843112_00014_52183_3679.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_201418_000001203112_00014_52183_3621.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_201846_000000723112_00014_52183_3625.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_205615_000006833112_00014_52183_3628.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_205615_000006833112_00014_52183_3630.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_211755_000004413112_00014_52183_3654.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_213212_000003503112_00015_52184_3655.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_213916_000001143112_00015_52184_3656.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_215327_000003023112_00015_52184_3659.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_223629_000006103112_00015_52184_3662.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_230942_000002953112_00016_52185_3674.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_232840_000001083112_00016_52185_3673.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_233939_000002413112_00016_52185_3677.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDE20120220_235858_000001143112_00016_52185_3676.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_073422_000005193112_00006_52175_8848.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_082202_000004223112_00007_52176_8849.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_083122_000000843112_00007_52176_8851.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_083128_000002953112_00007_52176_8883.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_084957_000003023112_00007_52176_8884.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_085614_000001693112_00007_52176_8885.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_091441_000004893112_00007_52176_8887.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_100318_000005553112_00008_52177_8896.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_101615_000001993112_00008_52177_8921.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_102352_000000903112_00008_52177_8922.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_103144_000001993112_00008_52177_8923.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_105452_000004473112_00008_52177_8930.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_114253_000001813112_00009_52178_8929.N1  ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

ASA_GM1_1PNPDK20120220_114731_000000723112_00009_52178_8934.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_114731_000000723112_00009_52178_8935.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_123504_000004043112_00009_52178_8967.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_124605_000001143112_00009_52178_8968.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_125544_000000783112_00009_52178_8970.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_125713_000005313112_00009_52178_8974.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_131554_000001083112_00010_52179_8973.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_131925_000005983112_00010_52179_8976.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_133242_000004413112_00010_52179_9000.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_135703_000005433112_00010_52179_9001.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_140612_000003023112_00010_52179_9003.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_141519_000004343112_00010_52179_9005.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_142453_000002053112_00010_52179_9006.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_143704_000002413112_00010_52179_9008.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_144646_000000783112_00010_52179_9010.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_145245_000008583112_00011_52180_9012.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_151655_000000843112_00011_52180_9029.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_152102_000001813112_00011_52180_9030.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_152709_000001753112_00011_52180_9031.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_153254_000000903112_00011_52180_9033.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_155532_000002773112_00011_52180_9034.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_160240_000002473112_00011_52180_9036.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_163248_000008643112_00012_52181_9038.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_165615_000005923112_00012_52181_9058.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_170907_000001503112_00012_52181_9063.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_173547_000006833112_00012_52181_9065.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_181243_000003863112_00013_52182_9066.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_182050_000003563112_00013_52182_9068.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_182544_000000783112_00013_52182_9083.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_183505_000004713112_00013_52182_9085.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_191601_000006283112_00013_52182_9088.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_194003_000002833112_00013_52182_9089.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_194856_000004413112_00014_52183_9090.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_GM1_1PNPDK20120220_195712_000002173112_00014_52183_9092.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing APM products...

Writing file ./RESULTS/DAILY/_120220/AUXILIARY/Check_ADFs_APM.xls...

Writing file ./RESULTS/DAILY/_120220/AUXILIARY/Check_ADFs_APM.txt...

ASA_APM_1PNPDE20120220_020744_000000793112_00003_52172_3336.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20120220_021334_000000833112_00003_52172_3339.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20120220_021648_000000573112_00003_52172_3338.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20120220_030226_000000853112_00003_52172_3341.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20120220_044951_000002653112_00005_52174_3400.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20120220_071820_000000433112_00006_52175_3444.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20120220_135430_000001333112_00010_52179_3586.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_APM_1PNPDE20120220_144542_000000443112_00010_52179_3589.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

Analysing IMM products...

Writing file ./RESULTS/DAILY/_120220/AUXILIARY/Check_ADFs_IMM.xls...

Writing file ./RESULTS/DAILY/_120220/AUXILIARY/Check_ADFs_IMM.txt...

ASA_IMM_1PNPDE20120220_025725_000000383112_00003_52172_3344.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120220_034138_000002633112_00004_52173_3337.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120220_070444_000001123112_00006_52175_3433.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120220_071339_000000403112_00006_52175_3443.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120220_071438_000001053112_00006_52175_3445.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120220_084446_000000533112_00007_52176_3493.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120220_102523_000000373112_00008_52177_3496.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120220_102759_000002153112_00008_52177_3497.N1	ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

```
ASA_IMM_1PNPDE20120220_111426_000000993112_00008_52177_3500.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120220_152402_000000393112_00011_52180_3590.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120220_170607_000001703112_00012_52181_3607.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDE20120220_203153_000000433112_00014_52183_3640.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20120220_065718_000002373112_00006_52175_8840.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_IMM_1PNPDK20120220_131504_000000373112_00010_52179_8983.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```

Analysing WSM products...

Writing file ./RESULTS/DAILY/_120220/AUXILIARY/Check_ADFs_WSM.xls...

Writing file ./RESULTS/DAILY/_120220/AUXILIARY/Check_ADFs_WSM.txt...

```
ASA_WSM_1PNPDE20120220_000031_000002083112_00002_52171_3306.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_000729_000003493112_00002_52171_3307.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_010257_000001773112_00002_52171_3308.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_012234_000001533112_00002_52171_3327.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_024249_000002513112_00003_52172_3340.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_031449_000000733112_00004_52173_3345.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_042109_000003923112_00004_52173_3399.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_052228_000002753112_00005_52174_3397.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_060008_000003923112_00005_52174_3431.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_070224_000000923112_00006_52175_3430.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_070931_000001903112_00006_52175_3434.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_083628_000004163112_00007_52176_3492.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_101939_000002513112_00008_52177_3495.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_110225_000002753112_00008_52177_3499.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_114556_000000923112_00009_52178_3501.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_114851_000002513112_00009_52178_3498.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_121715_000000733112_00009_52178_3502.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_122015_000001593112_00009_52178_3503.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_142238_000001283112_00010_52179_3587.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_144334_000000923112_00010_52179_3588.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_152535_000000923112_00011_52180_3591.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_160015_000001353112_00011_52180_3592.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_160652_000001533112_00011_52180_3585.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_163113_000000923112_00012_52181_3593.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_165111_000003003112_00012_52181_3606.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_174711_000001533112_00012_52181_3605.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_181912_000000923112_00013_52182_3610.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_183018_000002813112_00013_52182_3611.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_192643_000001533112_00013_52182_3615.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_194449_000002453112_00013_52182_3616.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_200942_000002693112_00014_52183_3634.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_201627_000001353112_00014_52183_3637.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_202005_000000983112_00014_52183_3638.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_210742_000000923112_00014_52183_3624.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_212519_000001533112_00014_52183_3641.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_212835_000002143112_00015_52184_3642.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_214652_000003923112_00015_52184_3658.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_215833_000002693112_00015_52184_3669.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_224644_000001533112_00015_52184_3653.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDE20120220_233033_000005383112_00016_52185_3682.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_013704_000000613112_00003_52172_8791.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_031626_000001223112_00004_52173_8805.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_074307_000002143112_00006_52175_8861.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_082905_000001353112_00007_52176_8862.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_083739_000001533112_00007_52176_8863.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_092255_000002203112_00007_52176_8899.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_101239_000002143112_00008_52177_8888.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_115235_000003613112_00009_52178_8943.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_124149_000002513112_00009_52178_8979.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_131748_000000923112_00010_52179_8984.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_132925_000001903112_00010_52179_8977.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_132925_000001903112_00010_52179_8978.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_150703_000005873112_00011_52180_9021.N1 ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
```




```

ASA_WSM_1PNPDK20120220_164716_000002693112_00012_52181_9046.N1   ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_182711_000002203112_00013_52182_9076.N1   ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_200100_000003123112_00014_52183_9099.N1   ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_200748_000001533112_00014_52183_9107.N1   ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_214115_000001903112_00015_52184_9124.N1   ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK
ASA_WSM_1PNPDK20120220_232503_000002083112_00016_52185_9138.N1   ASA_CON -> OKASA_INS -> OKASA_XCH -> OKASA_XCA -> OK

```

AUXILIARY FILES ANALYSIS completed

#####

MODULE STEPPING ANALYSIS

#####

Analysis will be performed from 2012-02-20 00:00:00 to 2012-02-20 23:59:59
 Results will be exported to the directory: ./RESULTS/DAILY/_120220/MODULE_STEPPING

Creating directory ./RESULTS/DAILY/_120220/MODULE_STEPPING...
 Creating directory ./RESULTS/DAILY/_120220/MODULE_STEPPING/FIRST_REFERENCE...
 Creating directory ./RESULTS/DAILY/_120220/MODULE_STEPPING/SECOND_REFERENCE...
 Creating directory ./RESULTS/DAILY/_120220/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...
 Deleting old files...

Creating images comparing with second reference...

Exporting results to the directory ../../RESULTS/DAILY/_120220/MODULE_STEPPING/SECOND_REFERENCE...

Polarization: H
 Reference product: ASA_MS__0PNPDK20010209_135042_0000009A024_00180_11700_0052.N1
 Test product: ASA_MS__0PNPDE20120220_223457_000000163112_00015_52184_0473.N1
 H
 H
 ../../RESULTS/DAILY/_120220/MODULE_STEPPING/SECOND_REFERENCE/TGH_20120220_223457-20010209_135042.png
 ../../RESULTS/DAILY/_120220/MODULE_STEPPING/SECOND_REFERENCE/TPH_20120220_223457-20010209_135042.png
 ../../RESULTS/DAILY/_120220/MODULE_STEPPING/SECOND_REFERENCE/RGH_20120220_223457-20010209_135042.png
 ../../RESULTS/DAILY/_120220/MODULE_STEPPING/SECOND_REFERENCE/RPH_20120220_223457-20010209_135042.png

Polarization: V
 Reference product: ASA_MS__0PNPDK20010209_140823_0000009A024_00180_11700_0054.N1
 Test product: ASA_MS__0PNPDE20120220_005156_000000163112_00002_52171_0472.N1
 V
 V
 ../../RESULTS/DAILY/_120220/MODULE_STEPPING/SECOND_REFERENCE/TGV_20120220_005156-20010209_140823.png
 ../../RESULTS/DAILY/_120220/MODULE_STEPPING/SECOND_REFERENCE/TPV_20120220_005156-20010209_140823.png
 ../../RESULTS/DAILY/_120220/MODULE_STEPPING/SECOND_REFERENCE/RGV_20120220_005156-20010209_140823.png
 ../../RESULTS/DAILY/_120220/MODULE_STEPPING/SECOND_REFERENCE/RPV_20120220_005156-20010209_140823.png

Creating images comparing with previous product reference...

Exporting results to the directory ../../RESULTS/DAILY/_120220/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE...

Polarization: H
 Reference product: ASA_MS__0PNPDE20120219_231142_000000163112_00001_52170_0471.N1
 Test product: ASA_MS__0PNPDE20120220_223457_000000163112_00015_52184_0473.N1
 H
 H
 ../../RESULTS/DAILY/_120220/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGH_20120220_223457-20120219_231142.png
 ../../RESULTS/DAILY/_120220/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPH_20120220_223457-20120219_231142.png
 ../../RESULTS/DAILY/_120220/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGH_20120220_223457-20120219_231142.png
 ../../RESULTS/DAILY/_120220/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPH_20120220_223457-20120219_231142.png

Polarization: V

Reference product: ASA_MS_0PNPDK20120219_062923_000000163111_00422_52160_1039.N1

Test product: ASA_MS_0PNPDE20120220_005156_000000163112_00002_52171_0472.N1

V
V

../../RESULTS/DAILY/_120220/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TGV_20120220_005156-20120219_062923.png
../../RESULTS/DAILY/_120220/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/TPV_20120220_005156-20120219_062923.png
../../RESULTS/DAILY/_120220/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RGV_20120220_005156-20120219_062923.png
../../RESULTS/DAILY/_120220/MODULE_STEPPING/PREVIOUS_PRODUCT_REFERENCE/RPV_20120220_005156-20120219_062923.png

MODULE_STEPPING ANALYSIS completed

#####

CALIBRATION PULSES ANALYSIS

#####

Creating directory ./RESULTS/DAILY/_120220/CALIBRATION_PULSES...

ALL ROWS Analysis will be performed from 2012-02-20 00:00:00 to 2012-02-20 23:59:59

Analysing products WVS IS2 V/V

1 81409 7 81409

Writing image ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Calibration_pulses_all_rows_WVS_IS2_VV.png...

Analysing products GM1 SS3 H/H

1 39265 7 39265

Writing image ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Calibration_pulses_all_rows_GM1_SS3_HH.png...

TEMPORAL EVOLUTION Analysis will be performed from 2012-02-20 00:00:00 to 2012-02-20 23:59:59

Analysing products WVS IS2 V/V

Getting calibration pulses data for WVS IS2 V/V from 2012-02-20 00:00:00 to 2012-02-20 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/_120220/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2012-02-20_1.dat...

Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_1.png...

Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_1.png...

Getting calibration pulses data for WVS IS2 V/V from 2012-02-20 00:00:00 to 2012-02-20 23:59:59. Rows: 2/6/10/14/18/22/26/30

Writing file ./RESULTS/DAILY/_120220/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2012-02-20_2.dat...

Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_2.png...

Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_2.png...

Getting calibration pulses data for WVS IS2 V/V from 2012-02-20 00:00:00 to 2012-02-20 23:59:59. Rows: 3/7/11/15/19/23/27/31

Writing file ./RESULTS/DAILY/_120220/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2012-02-20_3.dat...

Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_3.png...

Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_3.png...

Getting calibration pulses data for WVS IS2 V/V from 2012-02-20 00:00:00 to 2012-02-20 23:59:59. Rows: 4/8/12/16/20/24/28/32

Writing file ./RESULTS/DAILY/_120220/CALIBRATION_PULSES/Calibration_pulses_data_WVS_IS2_VV_2012-02-20_4.dat...

Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_WVS_IS2_VV_4.png...

Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Transmit_Power_WVS_IS2_VV_4.png...

Analysing products GM1 SS3 H/H

Getting calibration pulses data for GM1 SS3 H/H from 2012-02-20 00:00:00 to 2012-02-20 23:59:59. Rows: 1/5/9/13/17/21/25/29

Writing file ./RESULTS/DAILY/_120220/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2012-02-20_1.dat...

Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_1.png...

Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_1.png...



Getting calibration pulses data for GM1 SS3 H/H from 2012-02-20 00:00:00 to 2012-02-20 23:59:59. Rows: 2/6/10/14/18/22/26/30
 Writing file ./RESULTS/DAILY/_120220/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2012-02-20_2.dat...
 Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_2.png...
 Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_2.png...

Getting calibration pulses data for GM1 SS3 H/H from 2012-02-20 00:00:00 to 2012-02-20 23:59:59. Rows: 3/7/11/15/19/23/27/31
 Writing file ./RESULTS/DAILY/_120220/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2012-02-20_3.dat...
 Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_3.png...
 Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_3.png...

Getting calibration pulses data for GM1 SS3 H/H from 2012-02-20 00:00:00 to 2012-02-20 23:59:59. Rows: 4/8/12/16/20/24/28/32
 Writing file ./RESULTS/DAILY/_120220/CALIBRATION_PULSES/Calibration_pulses_data_GM1_SS3_HH_2012-02-20_4.dat...
 Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Average_P1_P1a_P2_P3_GM1_SS3_HH_4.png...
 Writing ../../RESULTS/DAILY/_120220//CALIBRATION_PULSES/Transmit_Power_GM1_SS3_HH_4.png...

CALIBRATION PULSES ANALYSIS completed
 #####

DOPPLER ANALYSIS
 #####
 Creating directory ./RESULTS/DAILY/_120220/DOPPLER...

 DOPPLER ANX Analysis will be performed from 2012-02-20 00:00:00 to 2012-02-20 23:59:59

Analysing products WVS IS2 V/V
 Getting doppler data for WVS IS2 V/V from 2012-02-20 00:00:00 to 2012-02-20 23:59:59...
 Writing file ./RESULTS/DAILY/_120220/DOPPLER/Doppler_data_WVS_IS2_VV_2012-02-20.dat...
 Running IDL program...
 Writing file ../../RESULTS/DAILY/_120220/DOPPLER/DOPPLER_ANX_WVS_IS2_VV.png...

Analysing products GM1 SS1 H/H
 Getting doppler data for GM1 SS1 H/H from 2012-02-20 00:00:00 to 2012-02-20 23:59:59...
 Writing file ./RESULTS/DAILY/_120220/DOPPLER/Doppler_data_GM1_SS1_HH_2012-02-20.dat...
 Running IDL program...
 Writing file ../../RESULTS/DAILY/_120220/DOPPLER/DOPPLER_ANX_GM1_SS1_HH.png...

 DOPPLER JUMPS Analysis will be performed on WSM products from 2012-02-20 00:00:00 to 2012-02-20 23:59:59

Analysing by default products WSM
 Getting doppler jumps data for WSM from 2012-02-20 00:00:00 to 2012-02-20 23:59:59...
 Writing file ./RESULTS/DAILY/_120220/DOPPLER/Doppler_Jumps_data_WSM_2012-02-20.dat...
 Running IDL program...
 Writing file ../../RESULTS/DAILY/_120220/DOPPLER/DOPPLER_JUMPS_ANX_WSM.png...
 Writing file ../../RESULTS/DAILY/_120220/DOPPLER/DOPPLER_JUMPS_Date_WSM.png...

 DOPPLER MAP Analysis will be performed from 2012-02-20 00:00:00 to 2012-02-20 23:59:59

Analysing products WVS IS2 V/V

1272
 Loading predicted doppler values....
 ./PREDICTED_DOPPLER/doppler.WV_2



Phase: descending
 Found data...
 Computing mean error doppler estimated-predicted...
 Mean error = -30.049841 Hz
 Writing file ../../RESULTS/DAILY/_120220//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_desc.jpg...
 Writing file ../../RESULTS/DAILY/_120220//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_desc.jpg...

1274
 Loading predicted doppler values....
 ./PREDICTED_DOPPLER/doppler.WV_2
 Phase: ascending
 Found data...
 Computing mean error doppler estimated-predicted...
 Mean error = -29.239532 Hz
 Writing file ../../RESULTS/DAILY/_120220//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_WVS_IS2_VV_asc.jpg...
 Writing file ../../RESULTS/DAILY/_120220//DOPPLER/DOPPLER_Absolute_WVS_IS2_VV_asc.jpg...

Analysing products GM1 SS1 H/H

2649
 Loading predicted doppler values....
 ./PREDICTED_DOPPLER/doppler.GM_1
 Phase: descending
 Found data...
 Computing mean error doppler estimated-predicted...
 Mean error = -5.7594647 Hz
 Writing file ../../RESULTS/DAILY/_120220//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_desc.jpg...
 Writing file ../../RESULTS/DAILY/_120220//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_desc.jpg...

2359
 Loading predicted doppler values....
 ./PREDICTED_DOPPLER/doppler.GM_1
 Phase: ascending
 Found data...
 Computing mean error doppler estimated-predicted...
 Mean error = -13.973473 Hz
 Writing file ../../RESULTS/DAILY/_120220//DOPPLER/DOPPLER_Estimated-Predicted-MeanError_GM1_SS1_HH_asc.jpg...
 Writing file ../../RESULTS/DAILY/_120220//DOPPLER/DOPPLER_Absolute_GM1_SS1_HH_asc.jpg...

DOPPLER ANALYSIS completed
 #####

CHIRP ANALYSIS
 #####
 Creating directory ./RESULTS/DAILY/_120220/CHIRP...

 CHIRP Analysis will be performed from 2012-02-20 00:00:00 to 2012-02-20 23:59:59

Analysing products WSM SS1 H/H

 Getting ScaleFactor data for WSM SS1 H/H from 2012-02-20 00:00:00 to 2012-02-20 23:59:59...

```
Writing file ./RESULTS/DAILY/_120220/CHIRP/ScaleFactor_data_WSM_SS1_HH_2012-02-20.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/_120220/CHIRP/ScaleFactor_ANX_WSM_SS1_HH.png...
Writing file ../../RESULTS/DAILY/_120220/CHIRP/ScaleFactor_DATE_WSM_SS1_HH.png...
```

Analysing products WSM SS1 V/V

```
*****
Getting ScaleFactor data for WSM SS1 V/V from 2012-02-20 00:00:00 to 2012-02-20 23:59:59...
Writing file ./RESULTS/DAILY/_120220/CHIRP/ScaleFactor_data_WSM_SS1_VV_2012-02-20.dat...
Running IDL program...
Writing file ../../RESULTS/DAILY/_120220/CHIRP/ScaleFactor_ANX_WSM_SS1_VV.png...
Writing file ../../RESULTS/DAILY/_120220/CHIRP/ScaleFactor_DATE_WSM_SS1_VV.png...
```

CHIRP ANALYSIS completed

#####

RAW DATA ANALYSIS

```
#####
Analysis will be performed from 2012-02-20 00:00:00 to 2012-02-20 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_120220/RAW_DATA
```

Creating directory ./RESULTS/DAILY/_120220/RAW_DATA...

```
*****
Getting raw data for WVS from 2012-02-20 00:00:00 to 2012-02-20 23:59:59...
Writing file ./RESULTS/DAILY/_120220/RAW_DATA/Raw_data_WVS_2012-02-20.dat...
Running IDL program to create graphs...
```

```
Creating image ../../RESULTS/DAILY/_120220/RAW_DATA/Raw_data_WVS_input_mean.png...
Creating image ../../RESULTS/DAILY/_120220/RAW_DATA/Raw_data_WVS_input_stdev.png...
Creating image ../../RESULTS/DAILY/_120220/RAW_DATA/Raw_data_WVS_gain_imbalance.png...
```

```
*****
Getting raw data for IMM from 2012-02-20 00:00:00 to 2012-02-20 23:59:59...
Writing file ./RESULTS/DAILY/_120220/RAW_DATA/Raw_data_IMM_2012-02-20.dat...
Running IDL program to create graphs...
```

```
Creating image ../../RESULTS/DAILY/_120220/RAW_DATA/Raw_data_IMM_input_mean.png...
Creating image ../../RESULTS/DAILY/_120220/RAW_DATA/Raw_data_IMM_input_stdev.png...
Creating image ../../RESULTS/DAILY/_120220/RAW_DATA/Raw_data_IMM_gain_imbalance.png...
```

RAW DATA ANALYSIS completed

#####

TELEMETRY ANALYSIS

```
#####
Analysis will be performed from 2012-02-20 00:00:00 to 2012-02-20 23:59:59
Results will be exported to the directory: ./RESULTS/DAILY/_120220/TELEMETRY
```

Creating directory ./RESULTS/DAILY/_120220/TELEMETRY...

Looking for gaps and missing lines in WVS products...

```
Checking 30 products from PDE...
Found product...ASA_WVS_1PNPDE20120220_010620_000004353112_00002_52171_3316.N1 / 1 gaps / 0 missing lines
Found product...ASA_WVS_1PNPDE20120220_010620_000004353112_00002_52171_3318.N1 / 1 gaps / 0 missing lines
Found product...ASA_WVS_1PNPDE20120220_035053_000007343112_00004_52173_3360.N1 / 1 gaps / 0 missing lines
Checking 25 products from PDK...
Found product...ASA_WVS_1PNPDK20120220_130609_000004983112_00009_52178_8975.N1 / 0 gaps / 8 missing lines
```

Looking for gaps and missing lines in GM1 products...

Checking 39 products from PDE...

Checking 47 products from PDK...

Looking for gaps and missing lines in APM products...

Checking 8 products from PDE...

No products from PDK...

Looking for gaps and missing lines in IMM products...

Checking 12 products from PDE...

Checking 2 products from PDK...

Looking for gaps and missing lines in WSM products...

Checking 40 products from PDE...

Found product...ASA_WSM_1PNPDE20120220_163113_00000923112_00012_52181_3593.N1 / 0 gaps / 16 missing lines

Checking 19 products from PDK...

Found product...ASA_WSM_1PNPDK20120220_013704_00000613112_00003_52172_8791.N1 / 5 gaps / 2443 missing lines

Found product...ASA_WSM_1PNPDK20120220_115235_000003613112_00009_52178_8943.N1 / 0 gaps / 1 missing lines

Creating graph of missing lines and gaps...

Creating image: ./RESULTS/DAILY/_120220/TELEMETRY/TELEMETRY_Missing_lines.png...

Creating image: ./RESULTS/DAILY/_120220/TELEMETRY/TELEMETRY_Gaps.png...

TELEMETRY ANALYSIS completed

#####

HTML REPORT generation

#####

Building file ./RESULTS/DAILY/_120220/asarReport.html...

Building DATA SUMMARY section...

Building AUXILIARY FILES ANALYSIS section...

Building MODULE STEPPING ANALYSIS section...

Building CALIBRATION PULSES ANALYSIS section...

Building DOPPLER ANALYSIS section...

Building CHIRP ANALYSIS section...

Building RAW DATA ANALYSIS section...

Building TELEMETRY ANALYSIS section...

HTML REPORT generation completed

#####



Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_APM_1PNPDE20120220_020744_000000793112_00003_52172_3336.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20120220_021334_000000833112_00003_52172_3339.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20120220_021648_000000573112_00003_52172_3338.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20120220_030226_000000853112_00003_52172_3341.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20120220_044951_000002653112_00005_52174_3400.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20120220_071820_000000433112_00006_52175_3444.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20120220_135430_000001333112_00010_52179_3586.N1	OK	OK	OK	OK
ASA_APM_1PNPDE20120220_144542_000000443112_00010_52179_3589.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_GM1_1PNPDE20120220_000406_000001993112_00002_52171_3309.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_001321_000003803112_00002_52171_3311.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_003539_000001083112_00002_52171_3312.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_003827_000003443112_00002_52171_3314.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_005329_000005673112_00002_52171_3317.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_005329_000005673112_00002_52171_3319.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_011941_000001693112_00002_52171_3342.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_014411_000011903112_00003_52172_3358.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_020551_000001083112_00003_52172_3357.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_021518_000000843112_00003_52172_3355.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_023341_000005433112_00003_52172_3352.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_025402_000000963112_00003_52172_3351.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_025552_000000903112_00003_52172_3350.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_025816_000002473112_00003_52172_3349.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_030413_000002473112_00003_52172_3348.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_031835_000013843112_00004_52173_3359.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_034609_000002833112_00004_52173_3361.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_041356_000004283112_00004_52173_3404.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_045437_000016683112_00005_52174_3406.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_052705_000001753112_00005_52174_3407.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_055412_000003503112_00005_52174_3449.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_064111_000009673112_00006_52175_3450.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_070645_000001633112_00006_52175_3451.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_071634_000001023112_00006_52175_3452.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_071925_000003503112_00006_52175_3456.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_200615_000000843112_00014_52183_3679.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_201418_000001203112_00014_52183_3621.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_201846_000000723112_00014_52183_3625.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_205615_000006833112_00014_52183_3628.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_205615_000006833112_00014_52183_3630.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_211755_000004413112_00014_52183_3654.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_213212_000003503112_00015_52184_3655.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_213916_000001143112_00015_52184_3656.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_215327_000003023112_00015_52184_3659.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_223629_000006103112_00015_52184_3662.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_230942_000002953112_00016_52185_3674.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_232840_000001083112_00016_52185_3673.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_233939_000002413112_00016_52185_3677.N1					OK	OK	OK	OK
ASA_GM1_1PNPDE20120220_235858_000001143112_00016_52185_3676.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_073422_000005193112_00006_52175_8848.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_082202_000004223112_00007_52176_8849.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_083122_000000843112_00007_52176_8851.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_083128_000002953112_00007_52176_8883.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_084957_000003023112_00007_52176_8884.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_085614_000001693112_00007_52176_8885.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_091441_000004893112_00007_52176_8887.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_100318_000005553112_00008_52177_8896.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_101615_000001993112_00008_52177_8921.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_102352_000000903112_00008_52177_8922.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_103144_000001993112_00008_52177_8923.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_105452_000004473112_00008_52177_8930.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_114253_000001813112_00009_52178_8929.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_114731_000000723112_00009_52178_8934.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_114731_000000723112_00009_52178_8935.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_123504_000004043112_00009_52178_8967.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_124605_000001143112_00009_52178_8968.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_125544_000000783112_00009_52178_8970.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_125713_000005313112_00009_52178_8974.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_131554_000001083112_00010_52179_8973.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_131925_000005983112_00010_52179_8976.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_133242_000004413112_00010_52179_9000.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_135703_000005433112_00010_52179_9001.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_140612_000003023112_00010_52179_9003.N1					OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_141519_000004343112_00010_52179_9005.N1					OK	OK	OK	OK

ASA_GM1_1PNPDK20120220_142453_000002053112_00010_52179_9006.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_143704_000002413112_00010_52179_9008.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_144646_000000783112_00010_52179_9010.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_145245_000008583112_00011_52180_9012.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_151655_00000843112_00011_52180_9029.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_152102_000001813112_00011_52180_9030.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_152709_000001753112_00011_52180_9031.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_153254_00000903112_00011_52180_9033.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_155532_000002773112_00011_52180_9034.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_160240_000002473112_00011_52180_9036.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_163248_000008643112_00012_52181_9038.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_165615_000005923112_00012_52181_9058.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_170907_000001503112_00012_52181_9063.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_173547_000006833112_00012_52181_9065.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_181243_000003863112_00013_52182_9066.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_182050_000003563112_00013_52182_9068.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_182544_000000783112_00013_52182_9083.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_183505_000004713112_00013_52182_9085.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_191601_000006283112_00013_52182_9088.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_194003_000002833112_00013_52182_9089.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_194856_000004413112_00014_52183_9090.N1	OK	OK	OK	OK
ASA_GM1_1PNPDK20120220_195712_000002173112_00014_52183_9092.N1	OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA
ASA_IMM_1PNPDE20120220_025725_000000383112_00003_52172_3344.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20120220_034138_000002633112_00004_52173_3337.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20120220_070444_000001123112_00006_52175_3433.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20120220_071339_000000403112_00006_52175_3443.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20120220_071438_000001053112_00006_52175_3445.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20120220_084446_000000533112_00007_52176_3493.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20120220_102523_000000373112_00008_52177_3496.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20120220_102759_000002153112_00008_52177_3497.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20120220_111426_000000993112_00008_52177_3500.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20120220_152402_000000393112_00011_52180_3590.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20120220_170607_000001703112_00012_52181_3607.N1	OK	OK	OK	OK
ASA_IMM_1PNPDE20120220_203153_000000433112_00014_52183_3640.N1	OK	OK	OK	OK
ASA_IMM_1PNPDK20120220_065718_000002373112_00006_52175_8840.N1	OK	OK	OK	OK
ASA_IMM_1PNPDK20120220_131504_000000373112_00010_52179_8983.N1	OK	OK	OK	OK





Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.

Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WSM_1PNPDE20120220_000031_000002083112_00002_52171_3306.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_000729_000003493112_00002_52171_3307.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_010257_000001773112_00002_52171_3308.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_012234_000001533112_00002_52171_3327.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_024249_000002513112_00003_52172_3340.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_031449_000000733112_00004_52173_3345.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_042109_000003923112_00004_52173_3399.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_052228_000002753112_00005_52174_3397.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_060008_000003923112_00005_52174_3431.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_070224_000000923112_00006_52175_3430.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_070931_000001903112_00006_52175_3434.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_083628_000004163112_00007_52176_3492.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_101939_000002513112_00008_52177_3495.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_110225_000002753112_00008_52177_3499.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_114556_000000923112_00009_52178_3501.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_114851_000002513112_00009_52178_3498.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_121715_000000733112_00009_52178_3502.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_122015_000001593112_00009_52178_3503.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_142238_000001283112_00010_52179_3587.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_144334_000000923112_00010_52179_3588.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_152535_000000923112_00011_52180_3591.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_160015_000001353112_00011_52180_3592.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_160652_000001533112_00011_52180_3585.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_163113_000000923112_00012_52181_3593.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_165111_000003003112_00012_52181_3606.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_174711_000001533112_00012_52181_3605.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_181912_000000923112_00013_52182_3610.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_183018_000002813112_00013_52182_3611.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_192643_000001533112_00013_52182_3615.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_194449_000002453112_00013_52182_3616.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_200942_000002693112_00014_52183_3634.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_201627_000001353112_00014_52183_3637.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_202005_000000983112_00014_52183_3638.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_210742_000000923112_00014_52183_3624.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_212519_000001533112_00014_52183_3641.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_212835_000002143112_00015_52184_3642.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_214652_000003923112_00015_52184_3658.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_215833_000002693112_00015_52184_3669.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_224644_000001533112_00015_52184_3653.N1					OK	OK	OK	OK
ASA_WSM_1PNPDE20120220_233033_000005383112_00016_52185_3682.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_013704_000000613112_00003_52172_8791.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_031626_000001223112_00004_52173_8805.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_074307_000002143112_00006_52175_8861.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_082905_000001353112_00007_52176_8862.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_083739_000001533112_00007_52176_8863.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_092255_000002203112_00007_52176_8899.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_101239_000002143112_00008_52177_8888.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_115235_000003613112_00009_52178_8943.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_124149_000002513112_00009_52178_8979.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_131748_000000923112_00010_52179_8984.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_132925_000001903112_00010_52179_8977.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_132925_000001903112_00010_52179_8978.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_150703_000005873112_00011_52180_9021.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_164716_000002693112_00012_52181_9046.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_182711_000002203112_00013_52182_9076.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_200100_000003123112_00014_52183_9099.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_200748_000001533112_00014_52183_9107.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_214115_000001903112_00015_52184_9124.N1					OK	OK	OK	OK
ASA_WSM_1PNPDK20120220_232503_000002083112_00016_52185_9138.N1					OK	OK	OK	OK

Differences with IECF operational ADFs list. If a wrong ADF is used, the filename is reported.





Product	ASA_CON	ASA_INS	ASA_XCH	ASA_XCA				
ASA_WVS_1PNPDE20120220_001942_000009143112_00002_52171_3313.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_004413_000004203112_00002_52171_3315.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_010620_000004353112_00002_52171_3316.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_010620_000004353112_00002_52171_3318.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_011235_000002853112_00002_52171_3343.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_012504_000006743112_00003_52172_3346.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_020405_000000593112_00003_52172_3356.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_020922_000001343112_00003_52172_3354.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_021752_000009003112_00003_52172_3353.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_024710_000003753112_00003_52172_3347.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_030822_000002993112_00004_52173_3362.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_035053_000007343112_00004_52173_3360.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_040253_000002853112_00004_52173_3402.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_041123_000001053112_00004_52173_3403.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_042741_000012743112_00004_52173_3409.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_053004_000010043112_00005_52174_3408.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_054618_000000603112_00005_52174_3447.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_054942_000002253112_00005_52174_3448.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_060702_000018443112_00005_52174_3453.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_072517_000001653112_00006_52175_3455.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_202142_000005693112_00014_52183_3623.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_203244_000013643112_00014_52183_3626.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_210913_000000753112_00014_52183_3627.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_210913_000000753112_00014_52183_3629.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_210958_000004353112_00014_52183_3657.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_220303_000018743112_00015_52184_3661.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_224921_000005243112_00015_52184_3660.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_225706_000007193112_00015_52184_3672.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_231437_000005843112_00016_52185_3675.N1					OK	OK	OK	OK
ASA_WVS_1PNPDE20120220_234343_000008693112_00016_52185_3678.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_072732_000003753112_00006_52175_8847.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_074716_000020393112_00006_52175_8850.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_085906_000008853112_00007_52176_8886.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_092730_000020993112_00007_52176_8891.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_103505_000011393112_00008_52177_8932.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_110743_000003453112_00008_52177_8931.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_111621_000015443112_00008_52177_8933.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_120621_000006143112_00009_52178_8966.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_122505_000005553112_00009_52178_8969.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_124806_000004203112_00009_52178_8971.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_130609_000004983112_00009_52178_8975.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_134007_000000903112_00010_52179_8999.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_134427_000005693112_00010_52179_9002.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_141114_000001953112_00010_52179_9004.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_142820_000004803112_00010_52179_9009.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_144105_000001043112_00010_52179_9007.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_144812_000001043112_00011_52180_9011.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_153007_000001193112_00011_52180_9032.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_153431_000012143112_00011_52180_9035.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_160923_000012743112_00011_52180_9037.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_171141_000014093112_00012_52181_9064.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_174942_000013343112_00012_52181_9067.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_184500_000018143112_00013_52182_9087.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_192914_000002103112_00013_52182_9086.N1					OK	OK	OK	OK
ASA_WVS_1PNPDK20120220_193517_000002403112_00013_52182_9091.N1					OK	OK	OK	OK

Calibration pulses for GM1 SS3 H/H

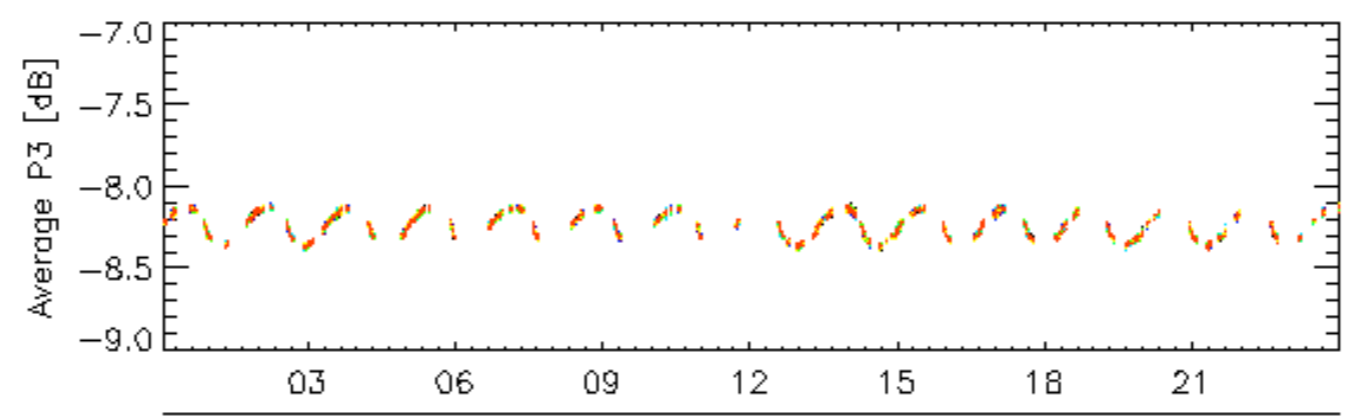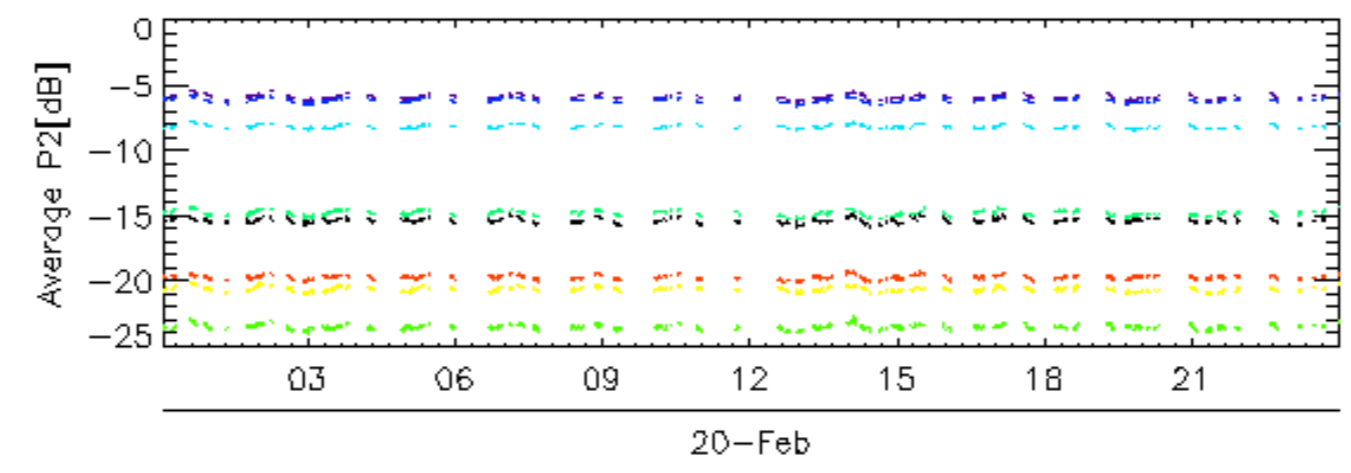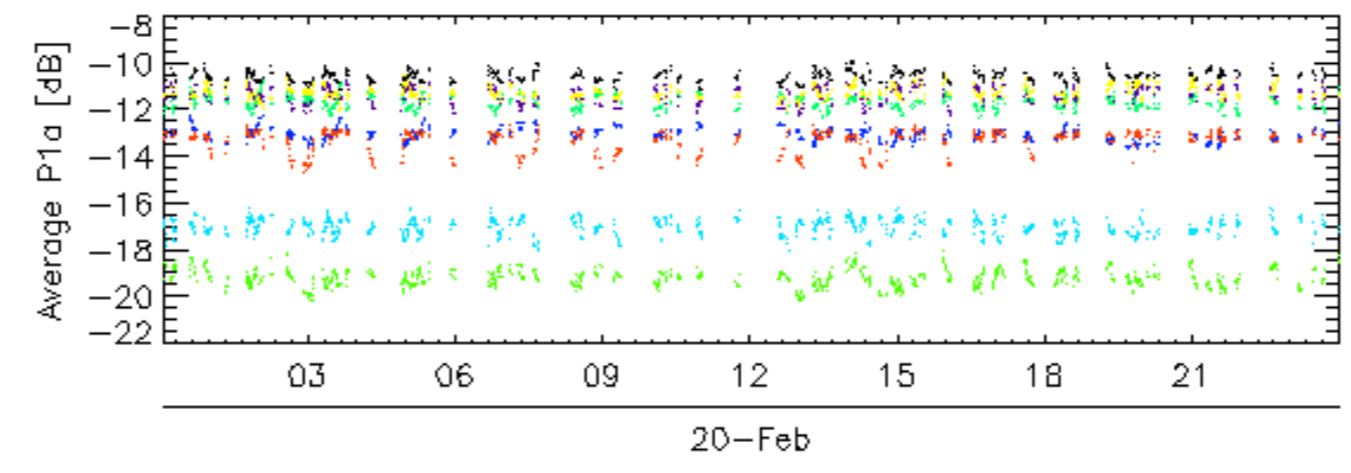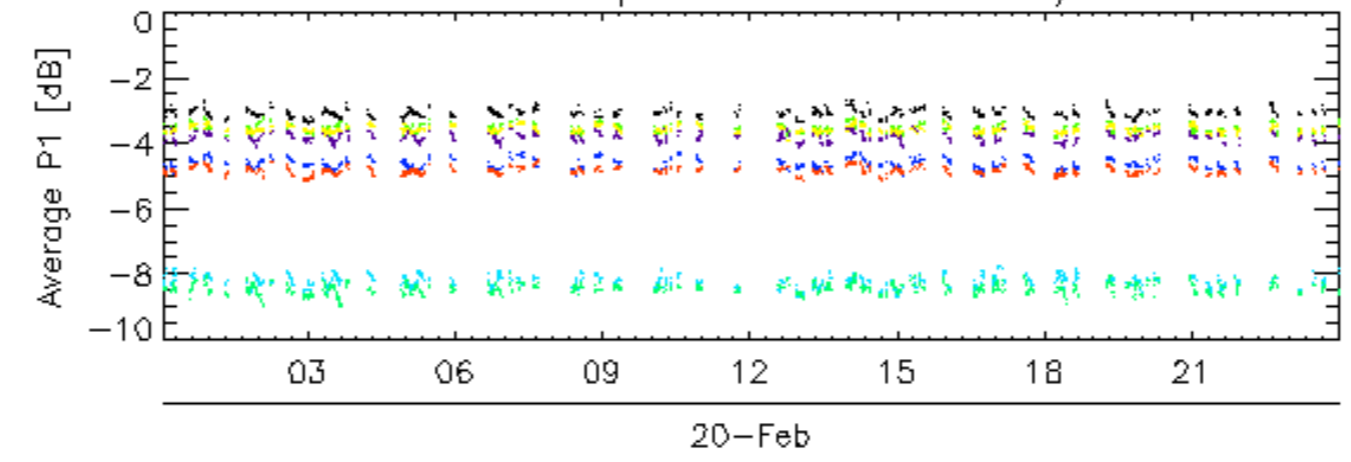


rows: 1 13 17 21 25 29 5 9

Calibration pulses for GM1 SS3 H/H

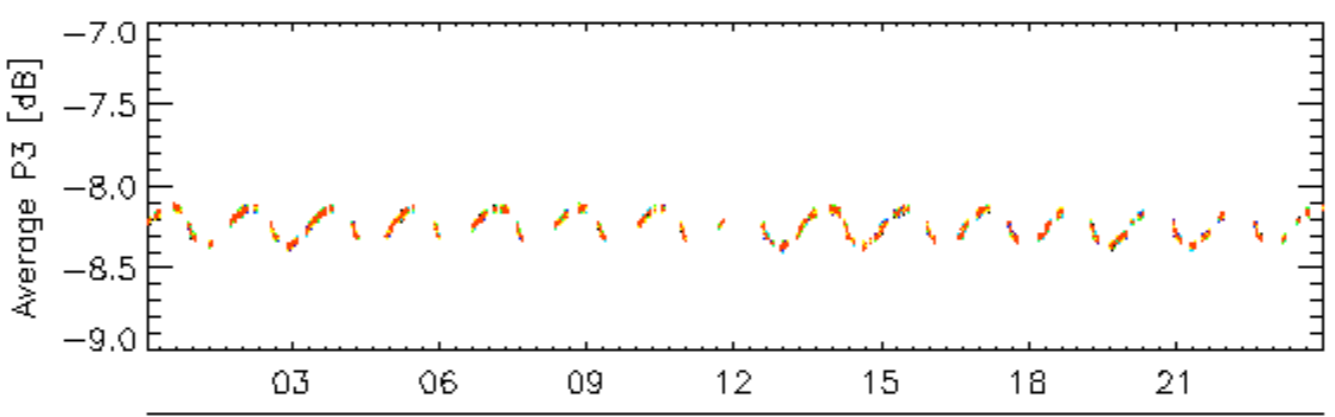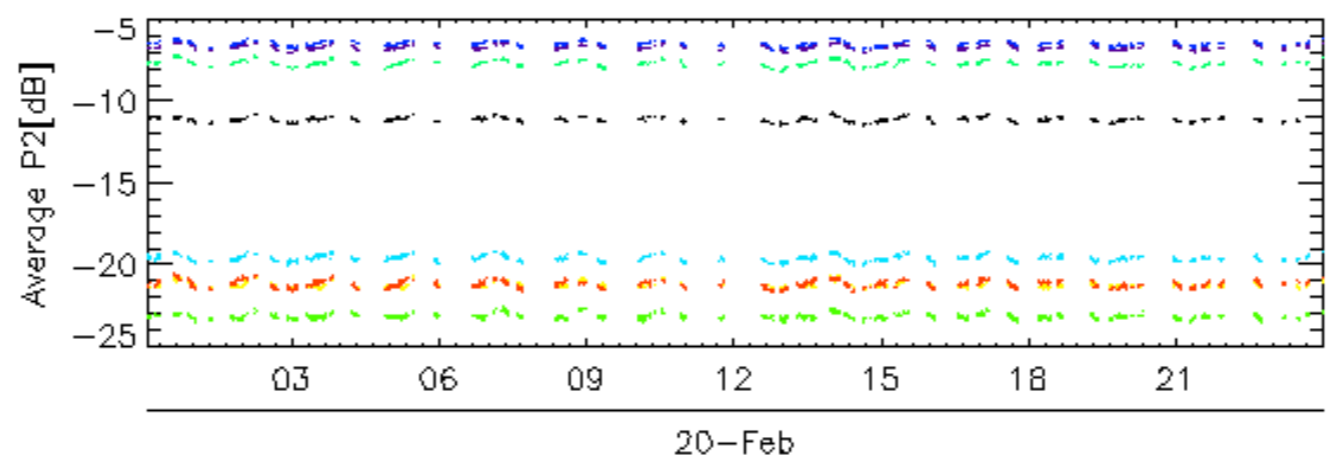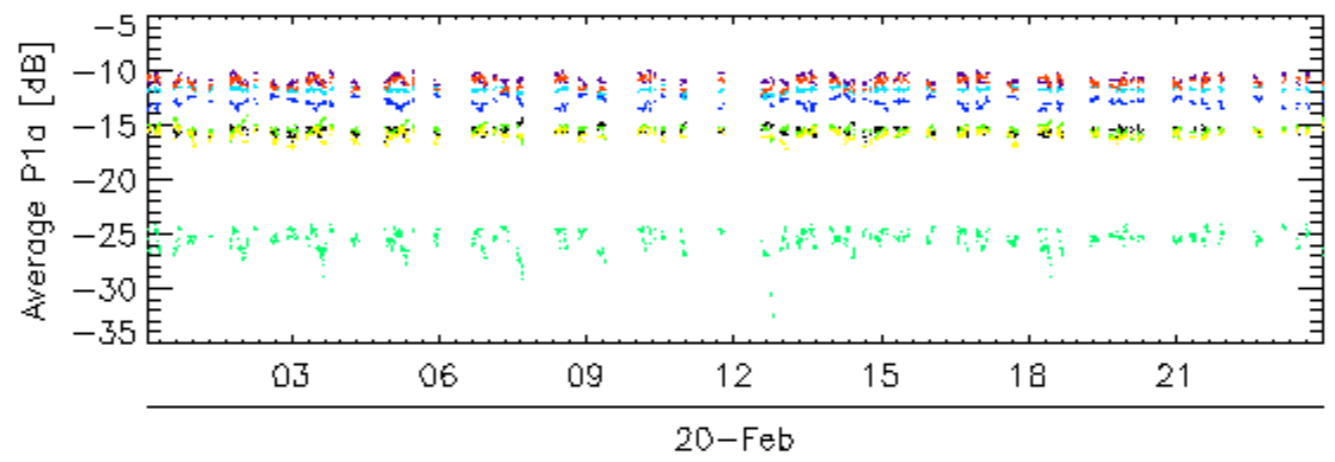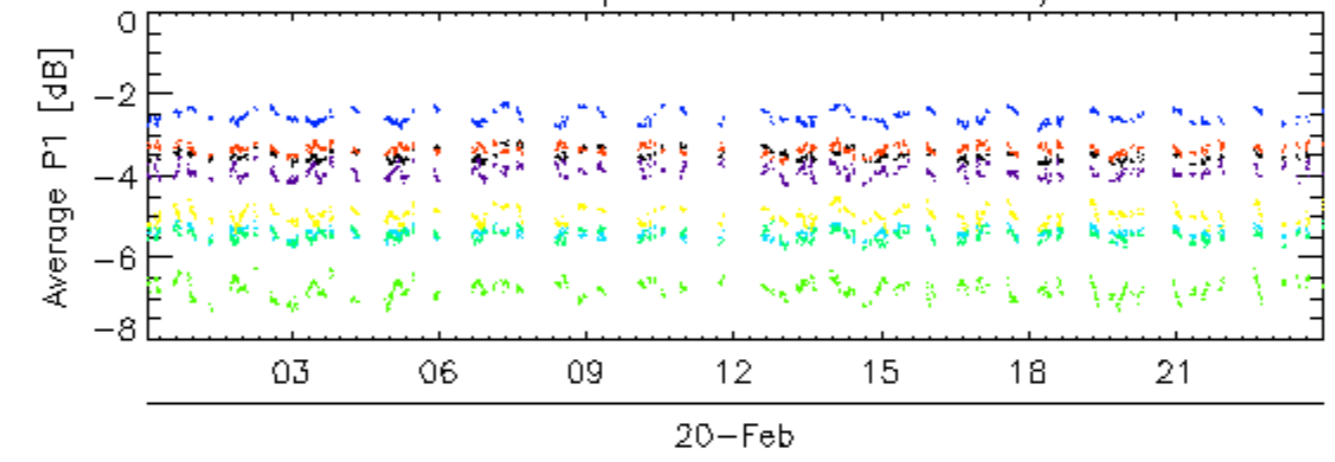


rows: 10 14 18 2 22 26 30 6


Calibration pulses for GM1 SS3 H/H

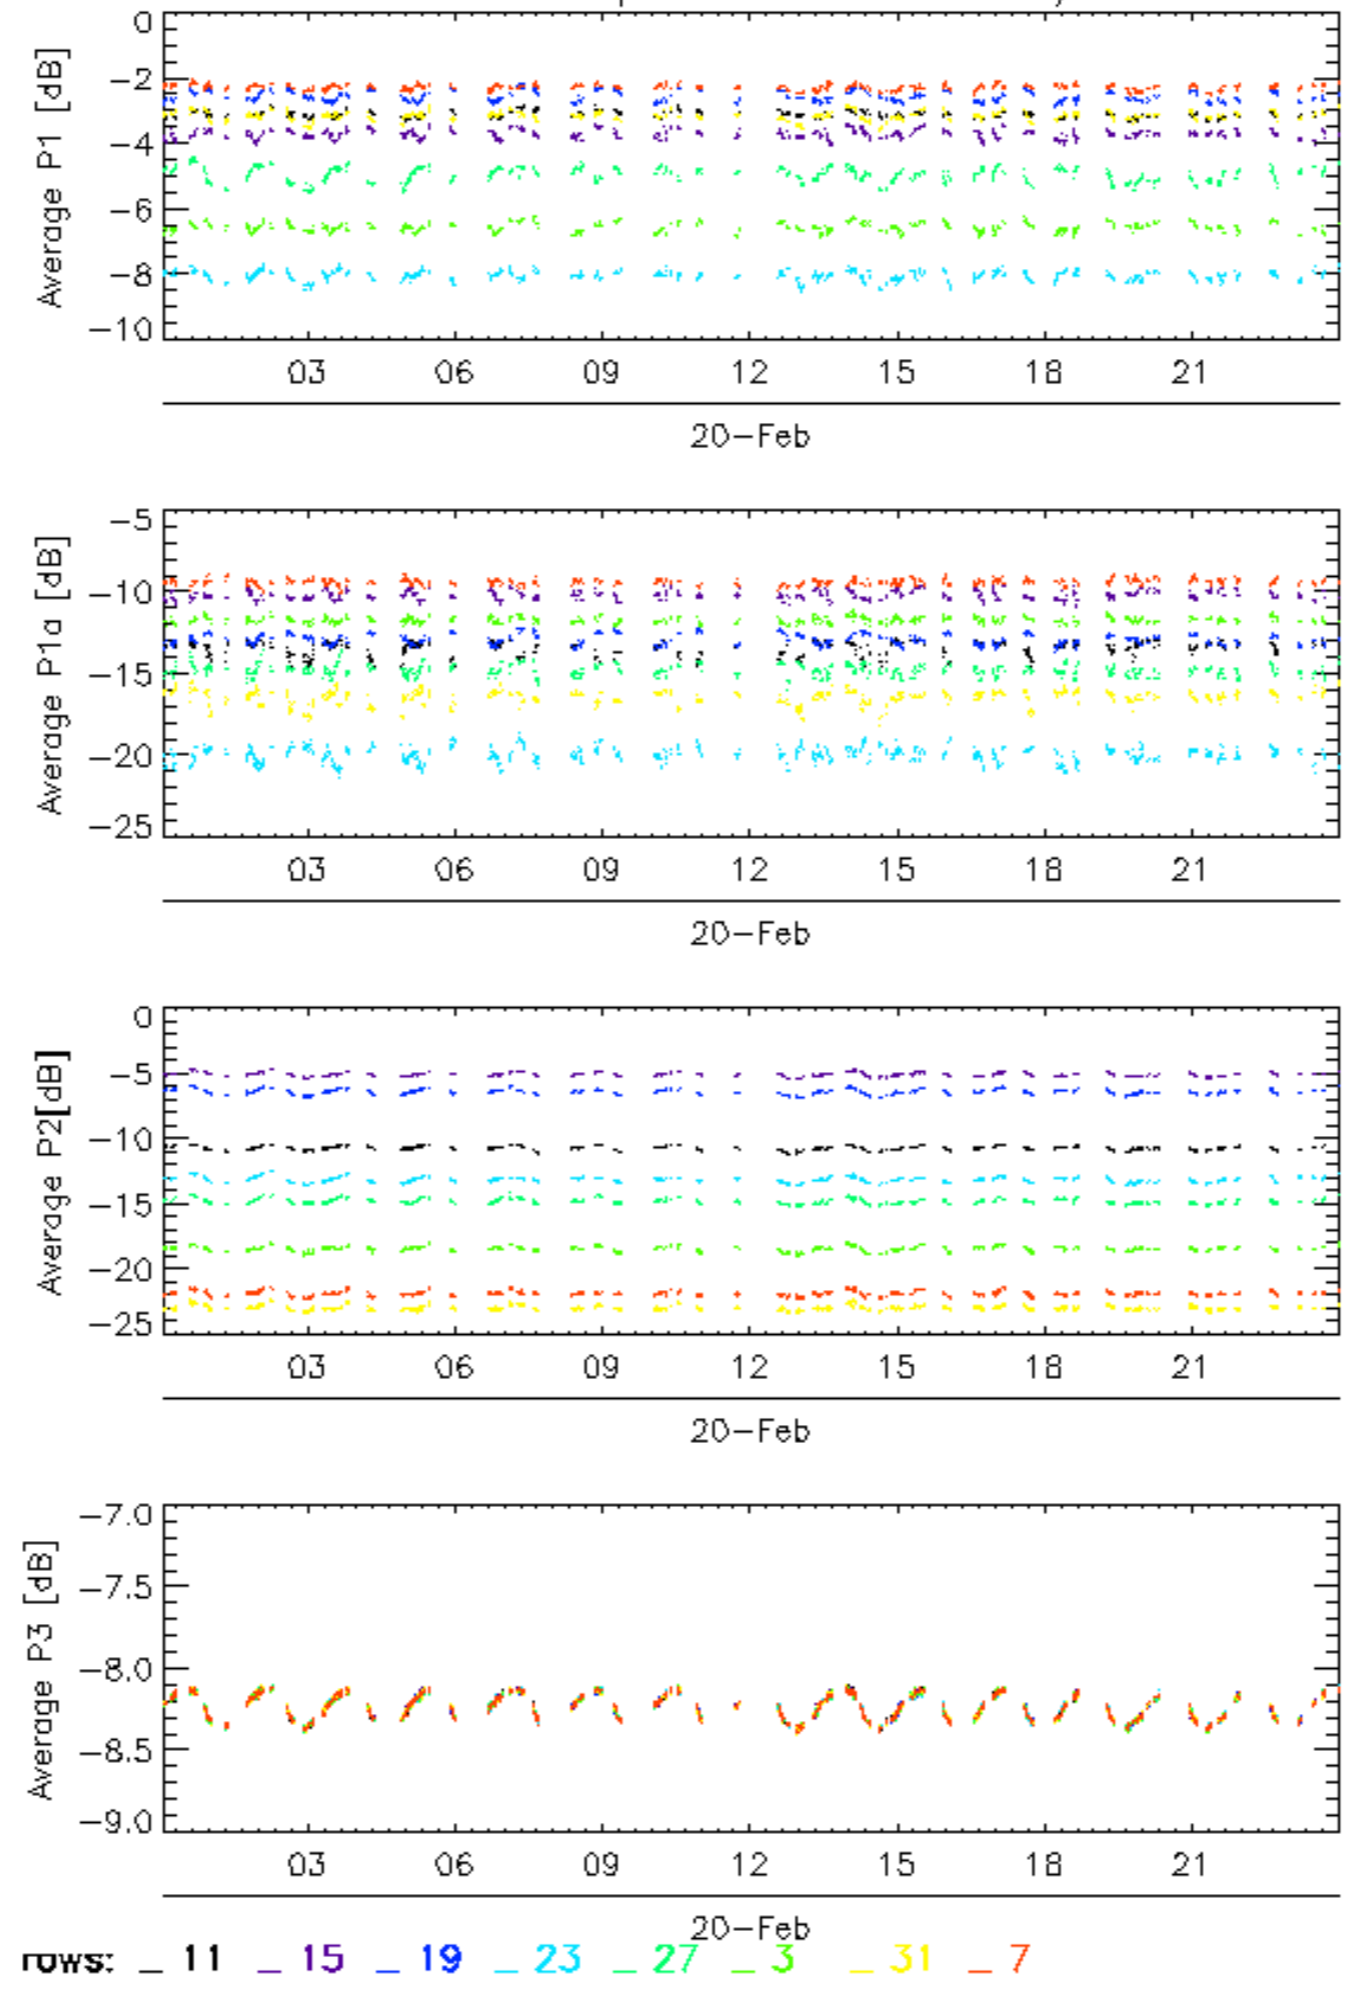


Calibration pulses for GM1 SS3 H/H

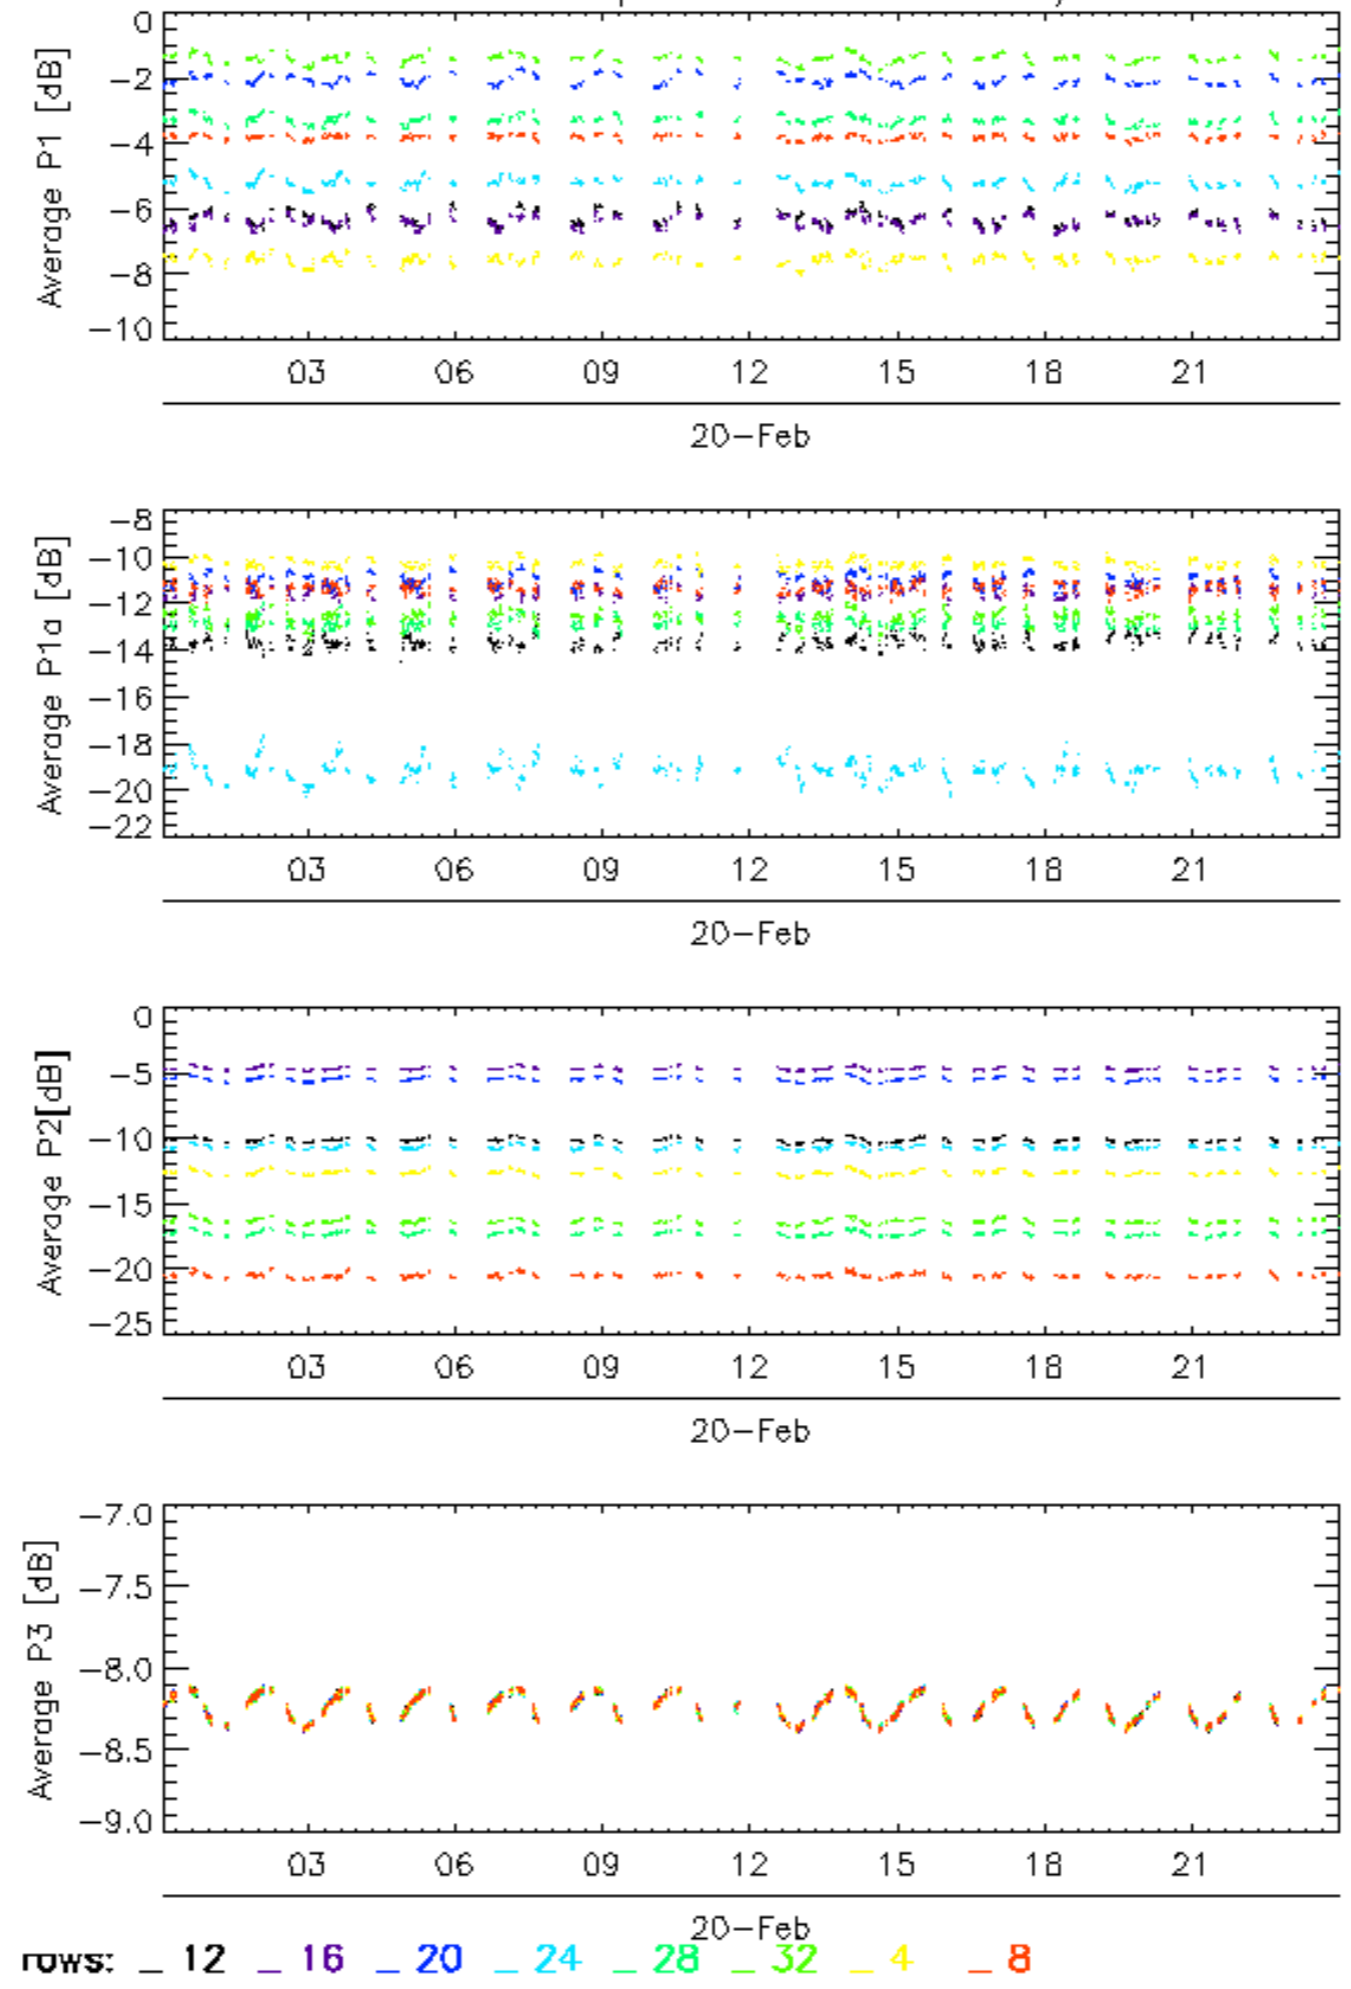


Calibration pulses for WVS IS2 V/V

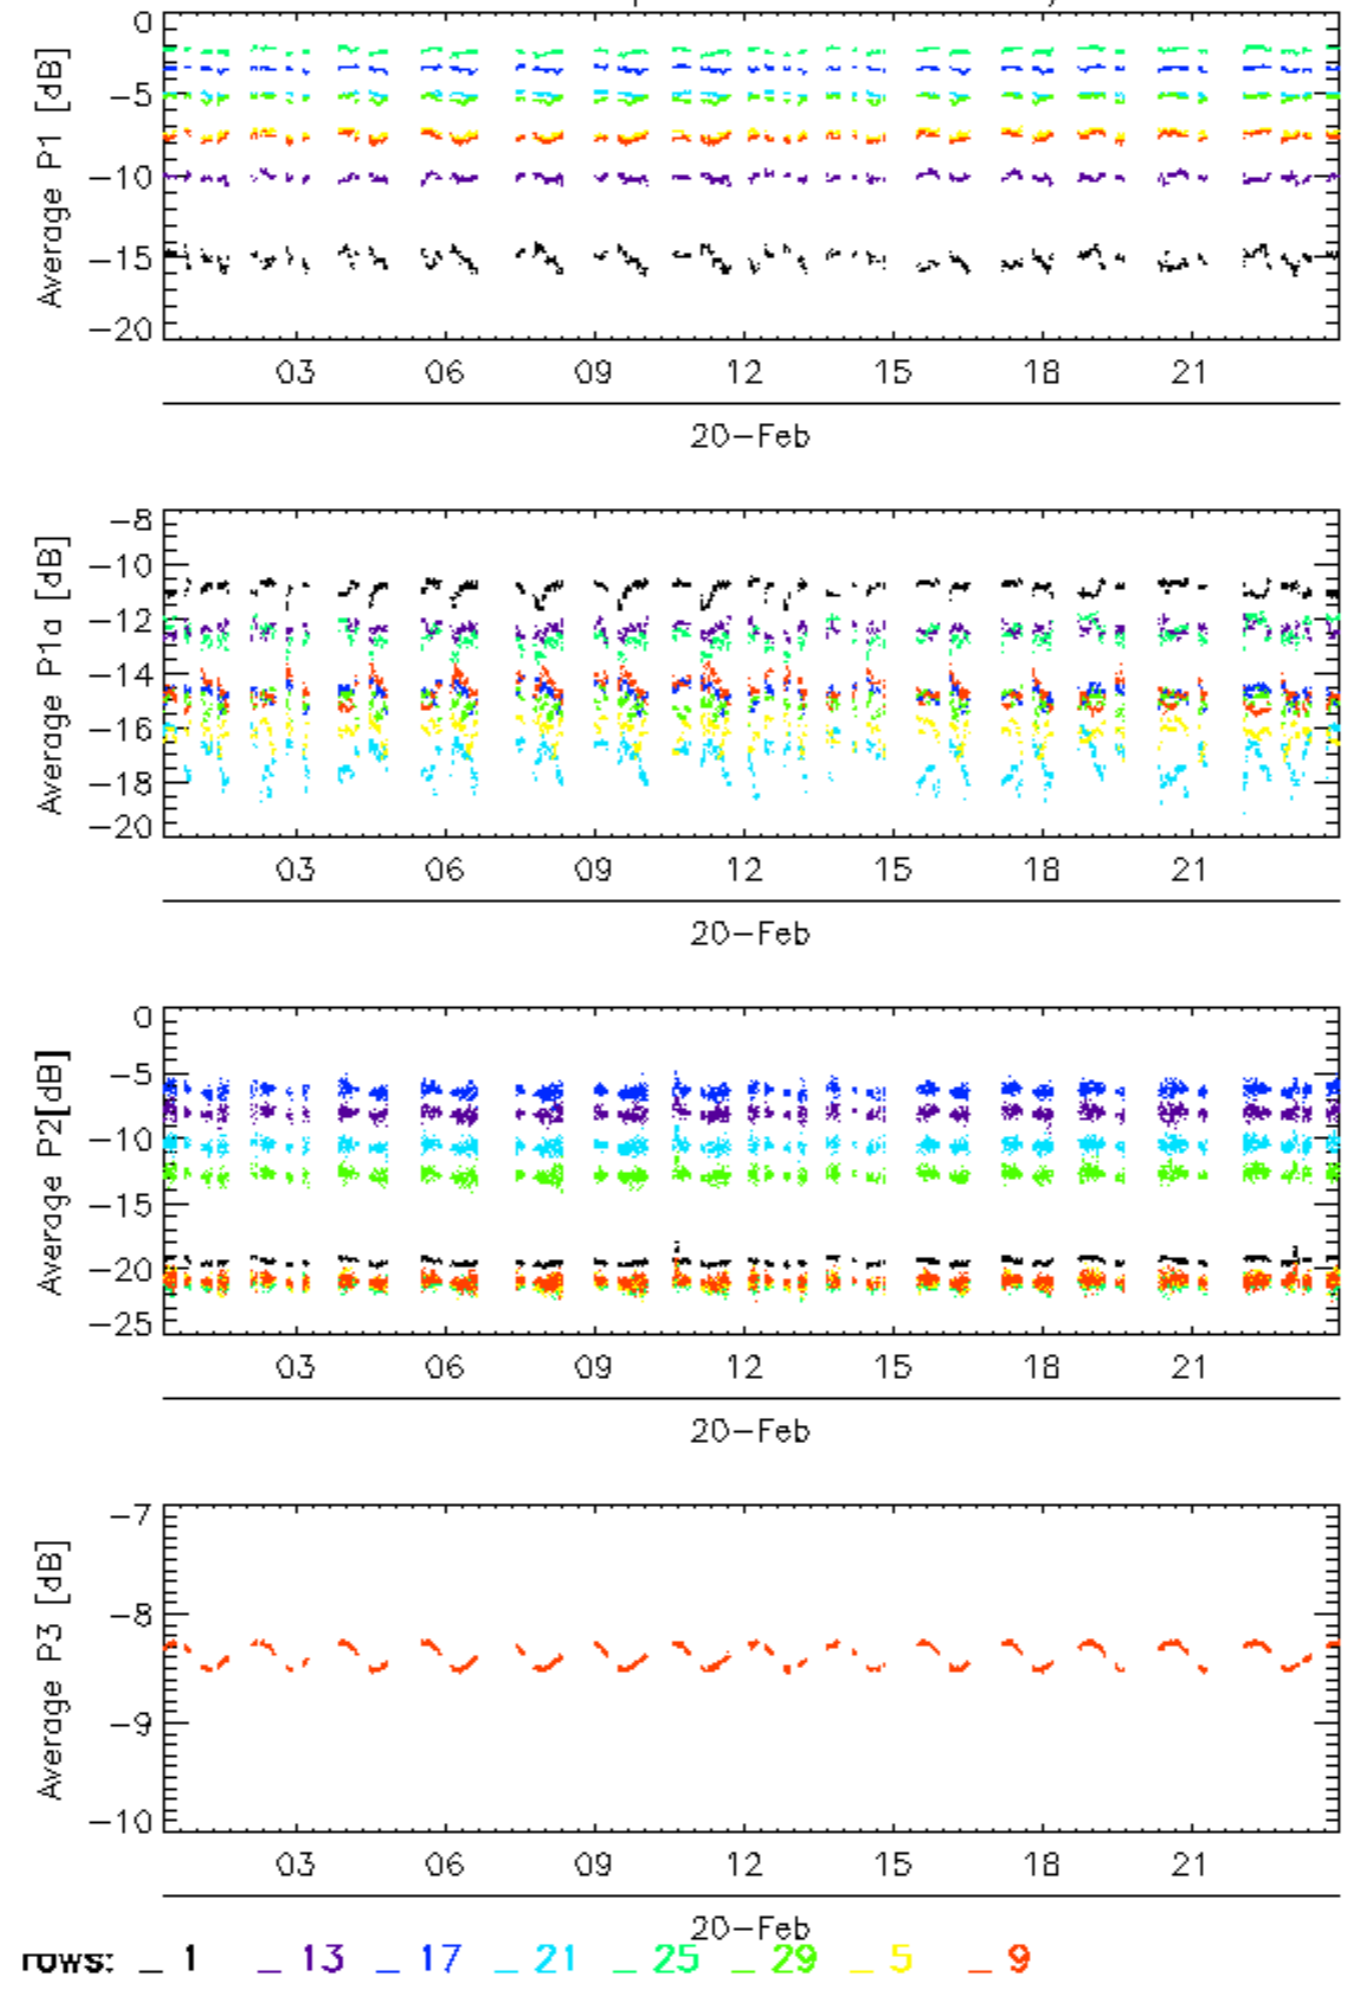


Calibration pulses for WVS IS2 V/V

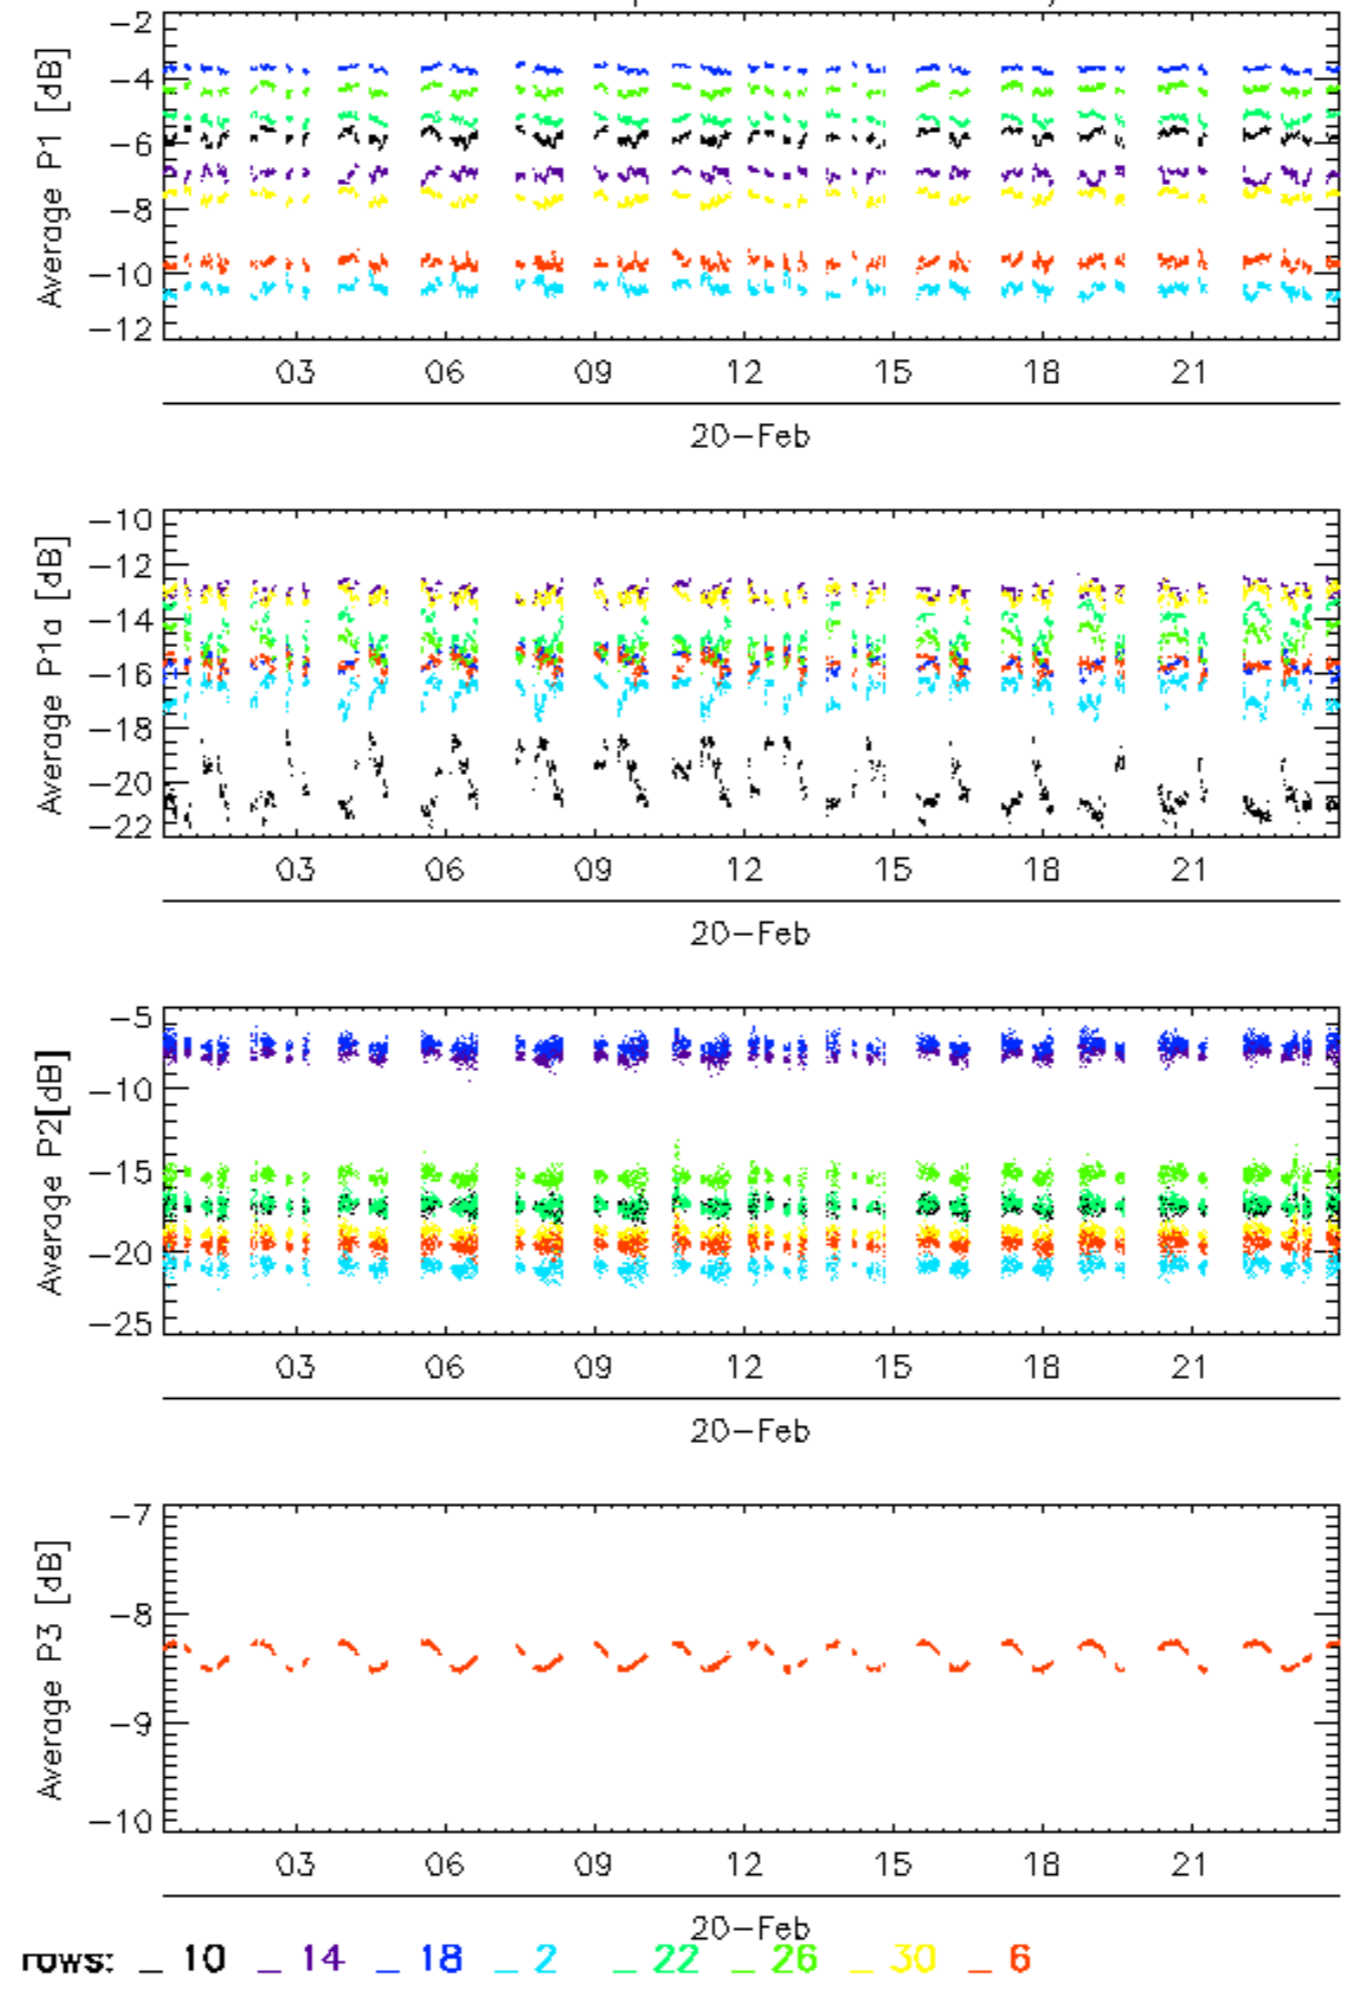


Calibration pulses for WVS IS2 V/V

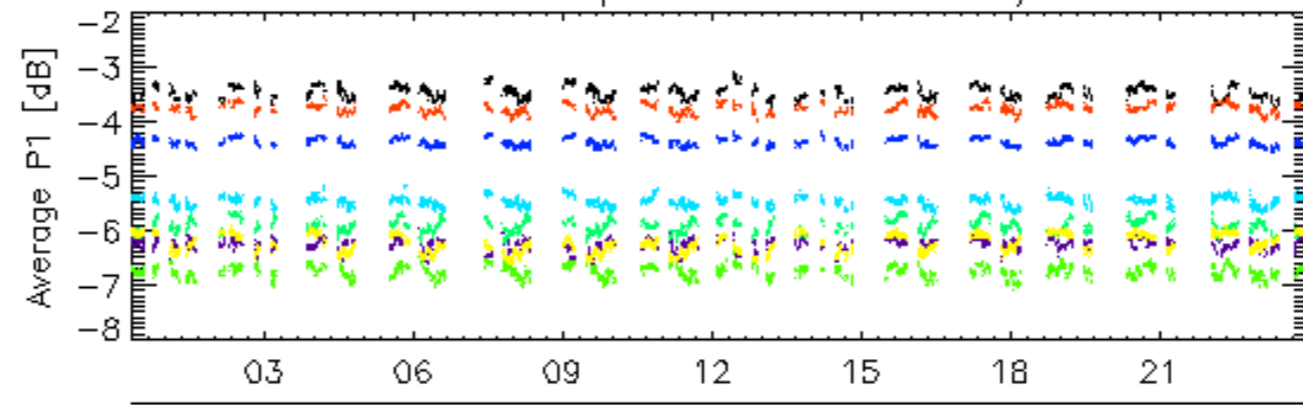


20-Feb

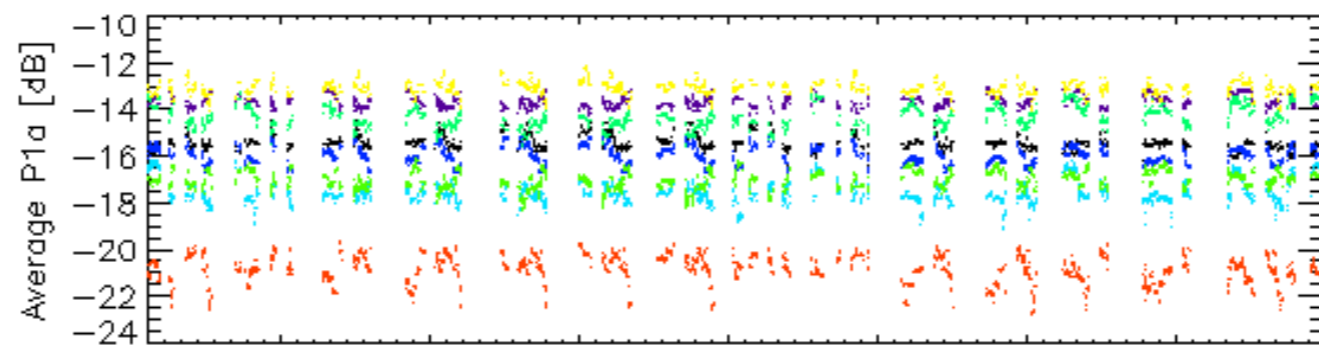

20-Feb

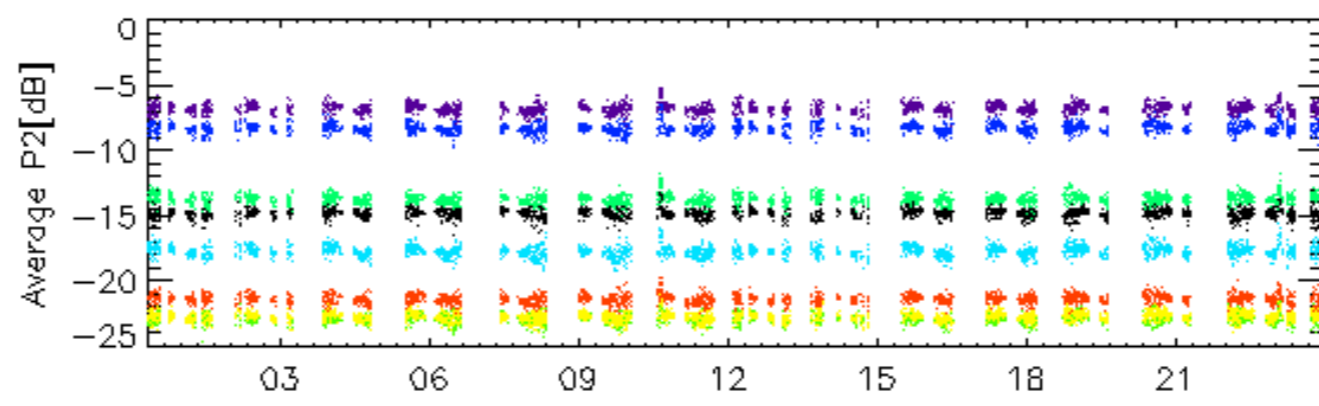


20-Feb

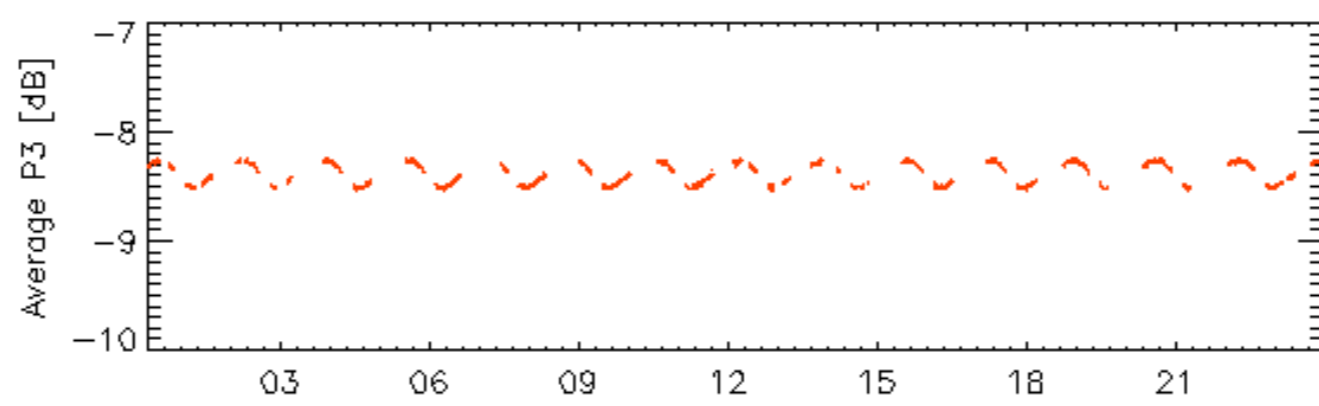


20-Feb

rows: _ 11 _ 15 _ 19 _ 23 _ 27 _ 3 _ 31 _ 7


Calibration pulses for WVS IS2 V/V

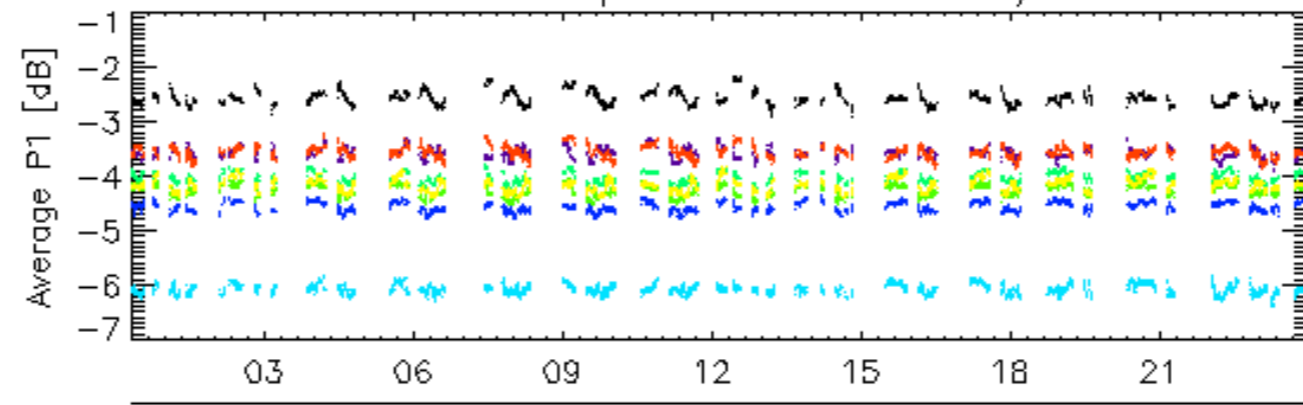


20-Feb

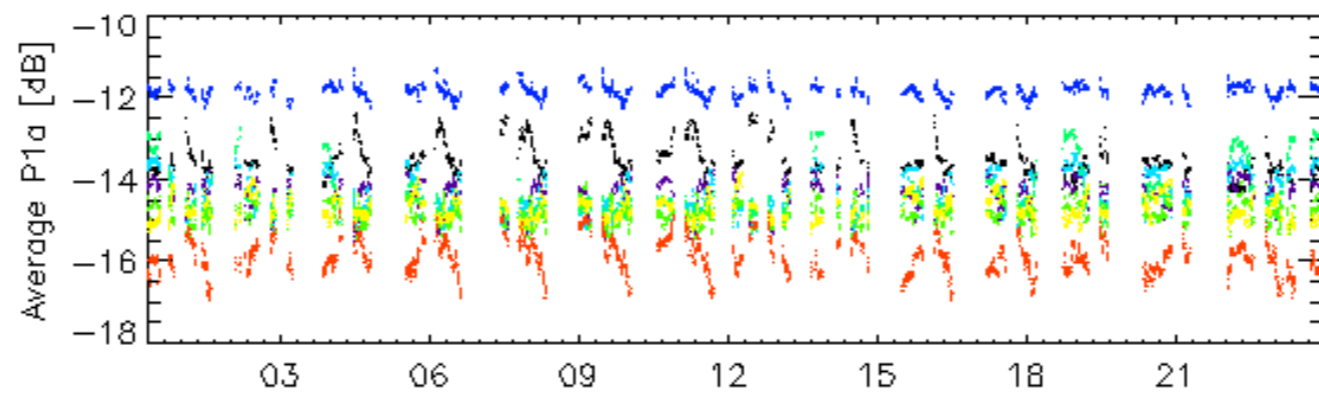

20-Feb

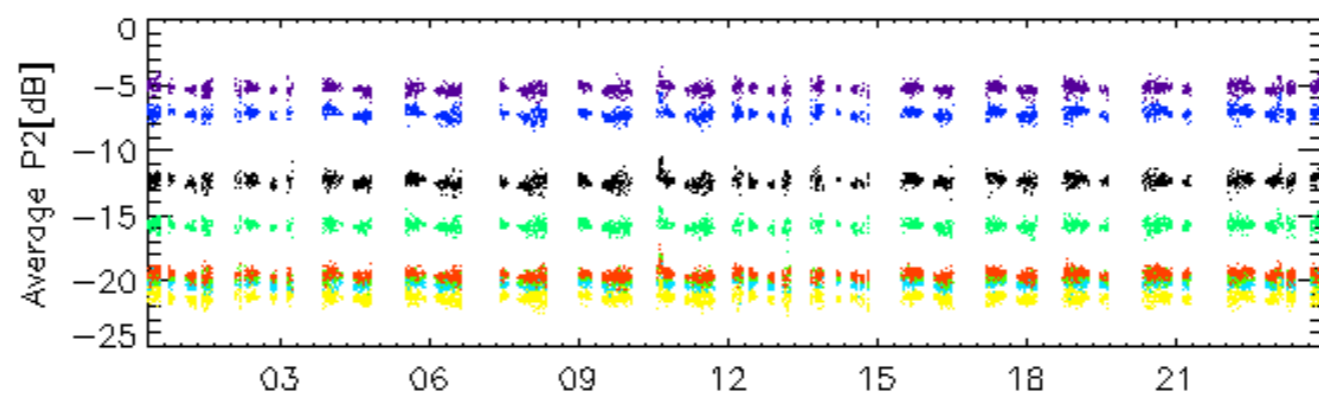



20-Feb


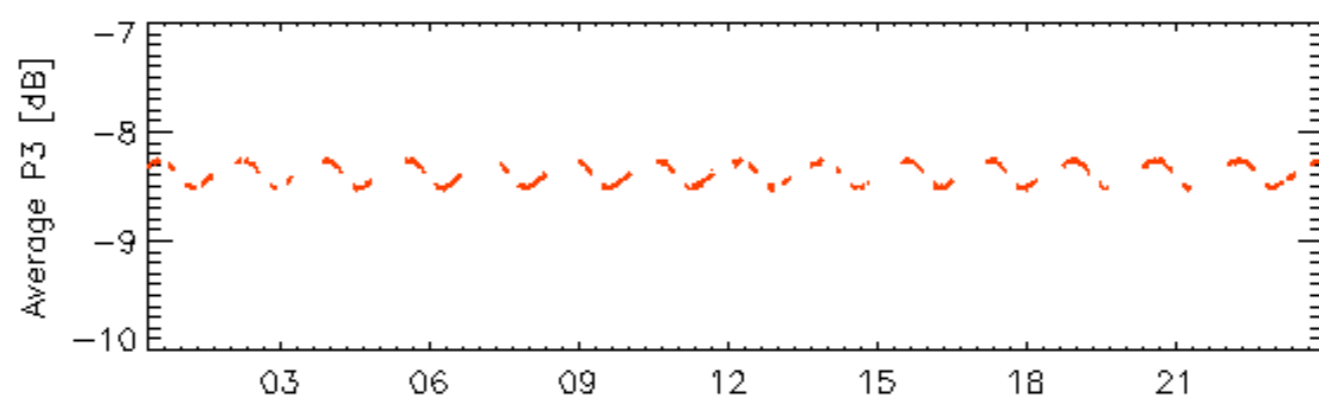


20-Feb



rows: — 12 — 16 — 20 — 24 — 28 — 32 — 4 — 8

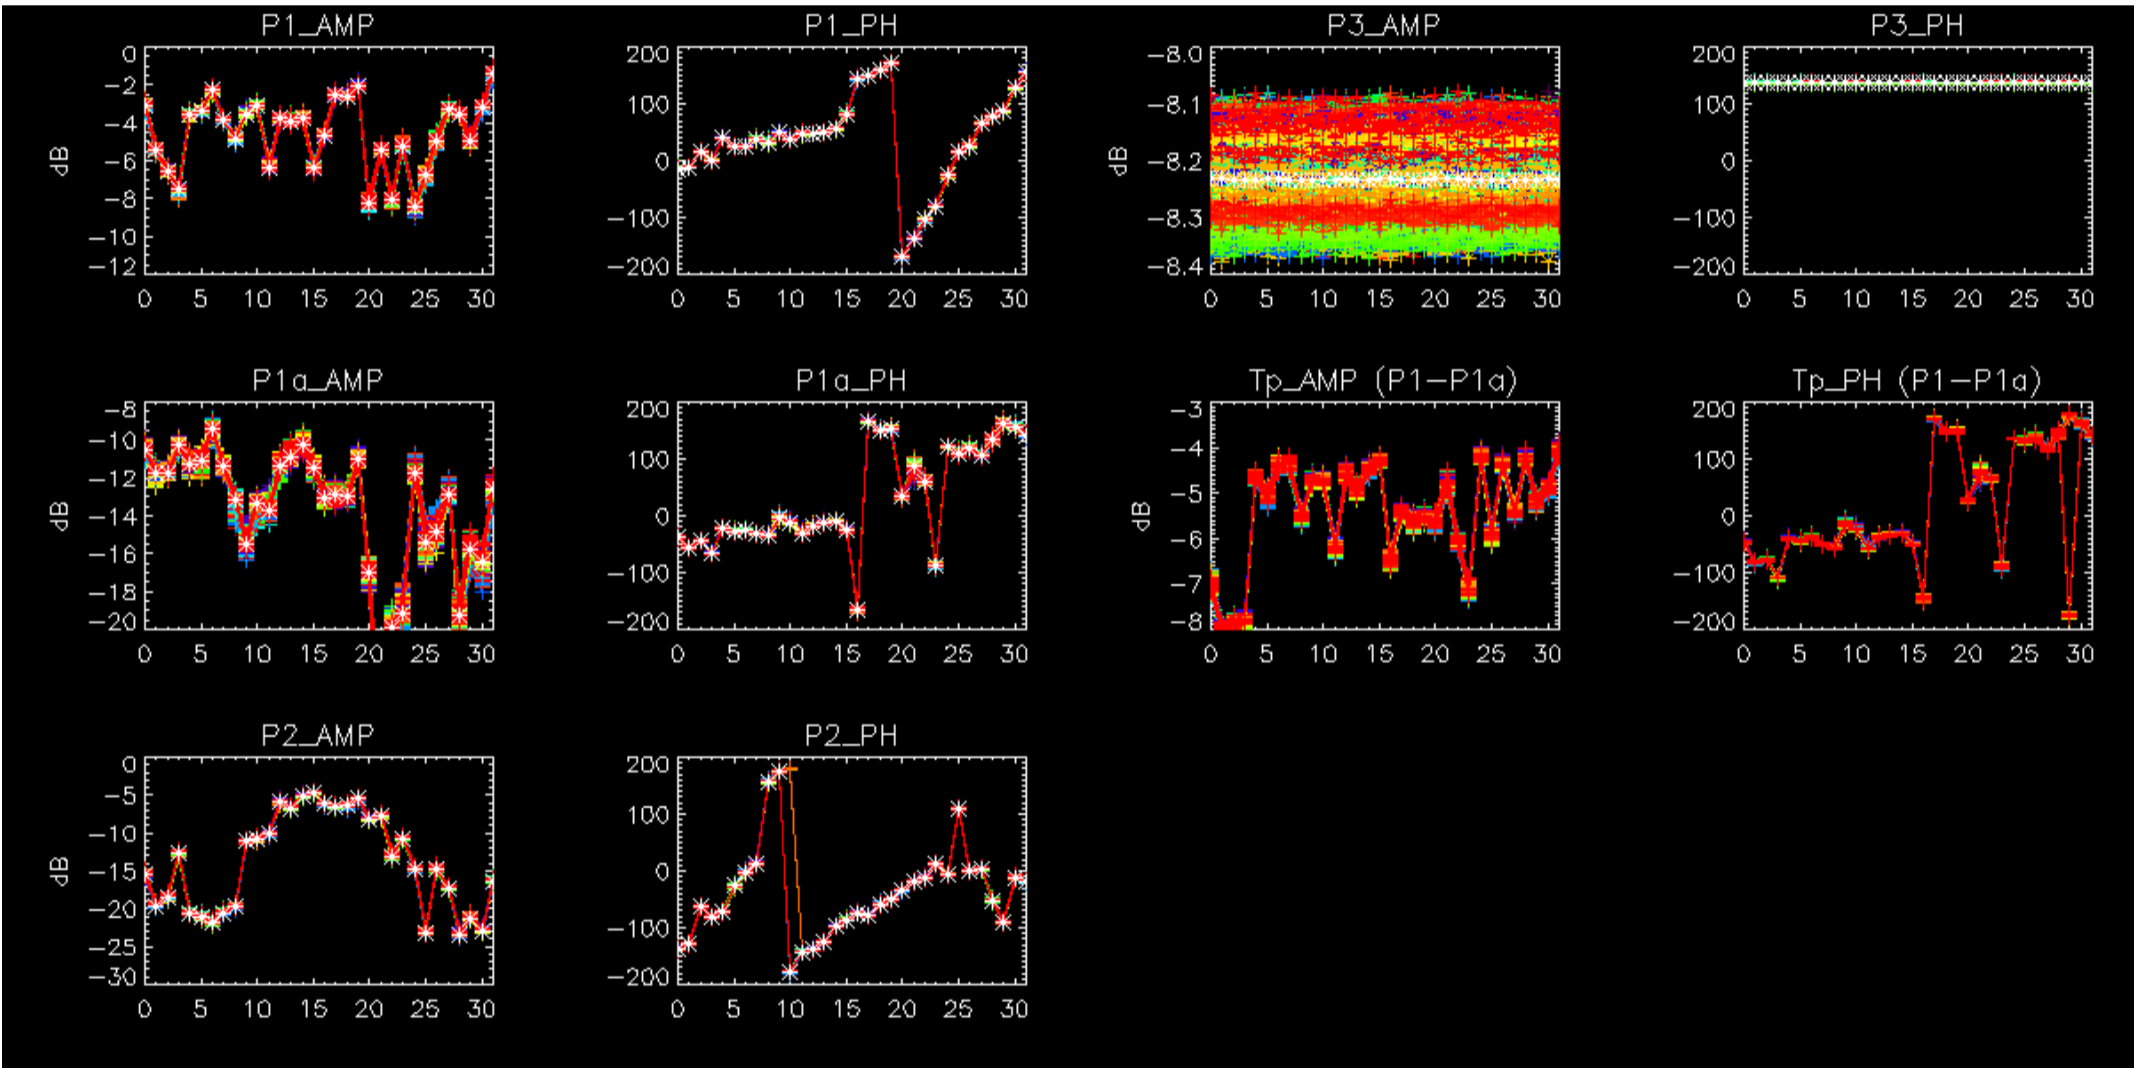


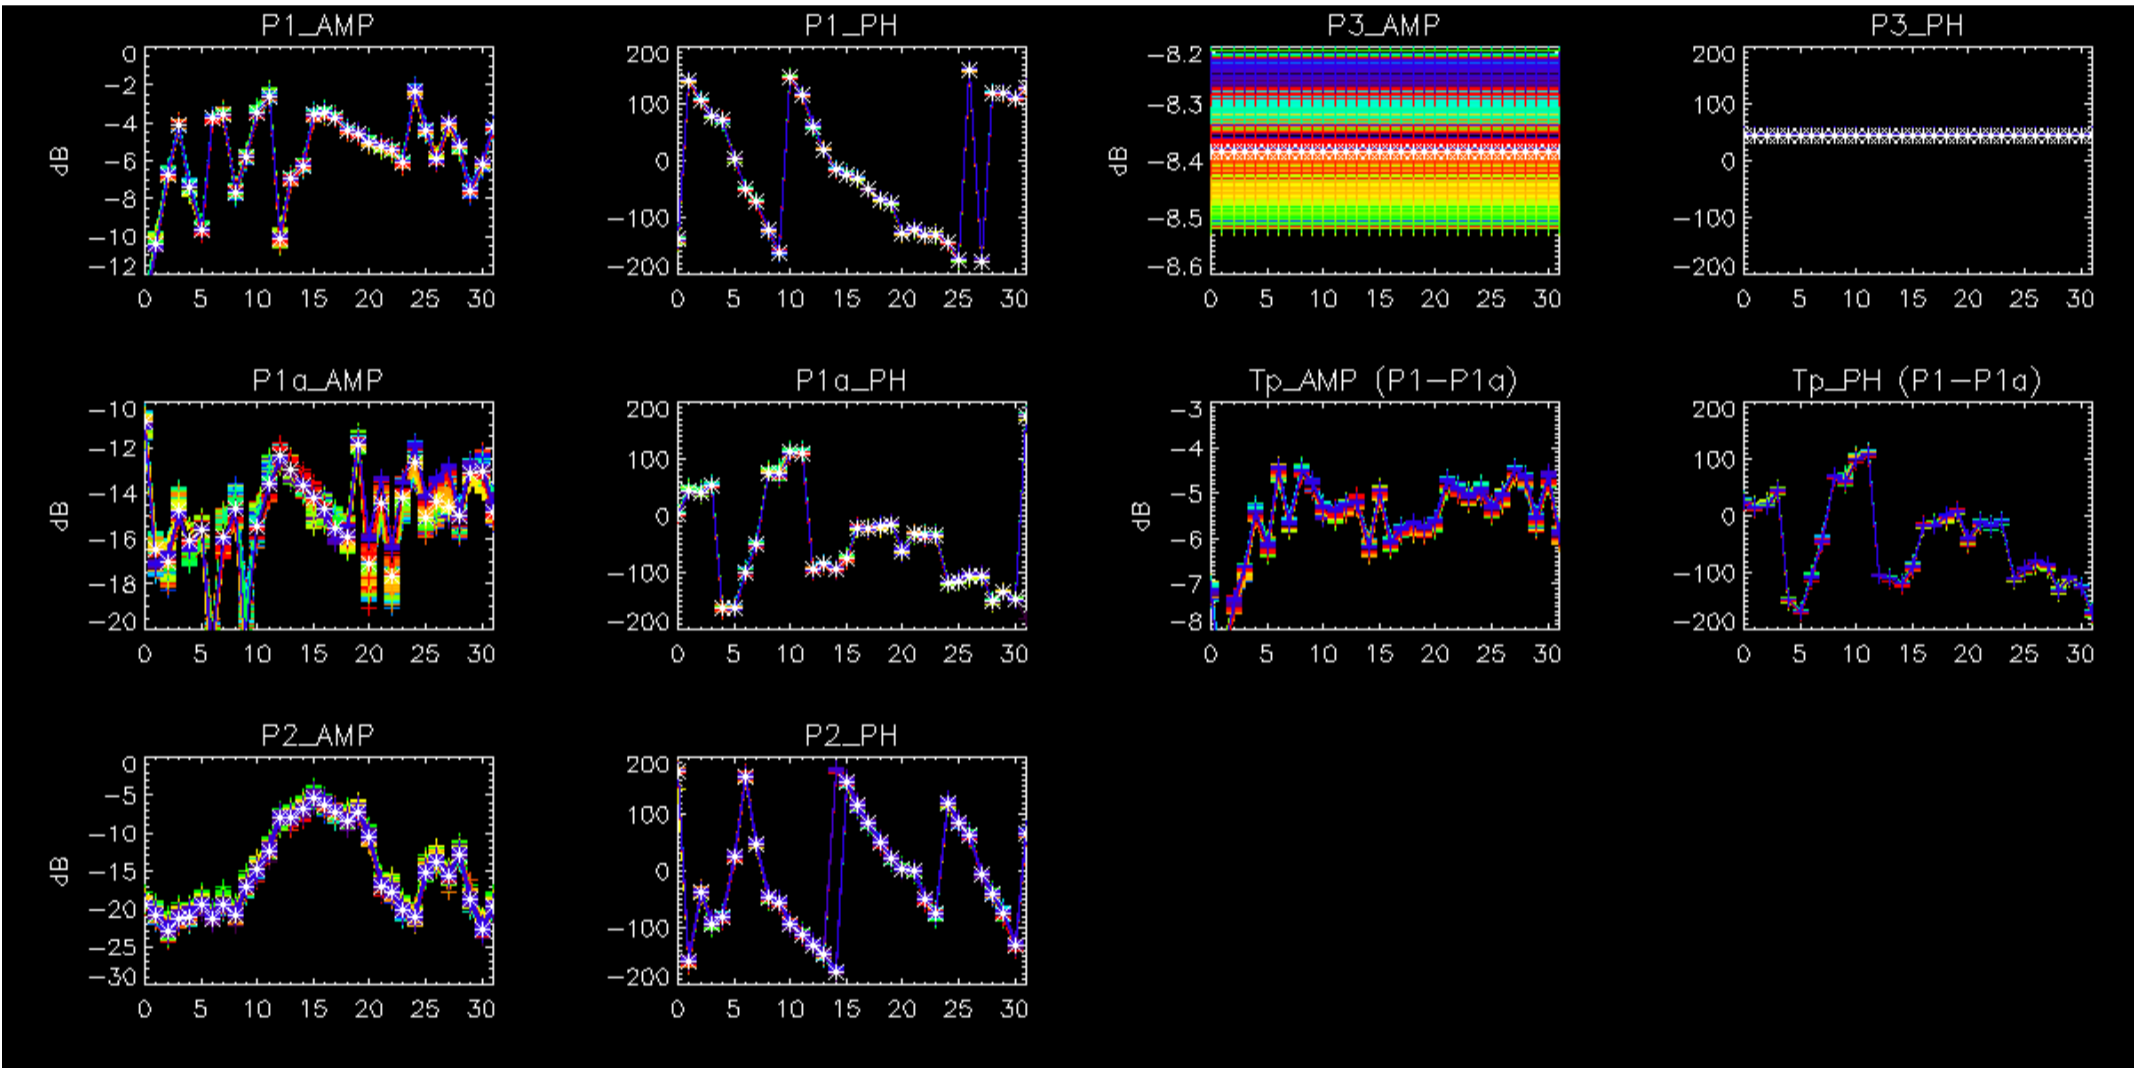


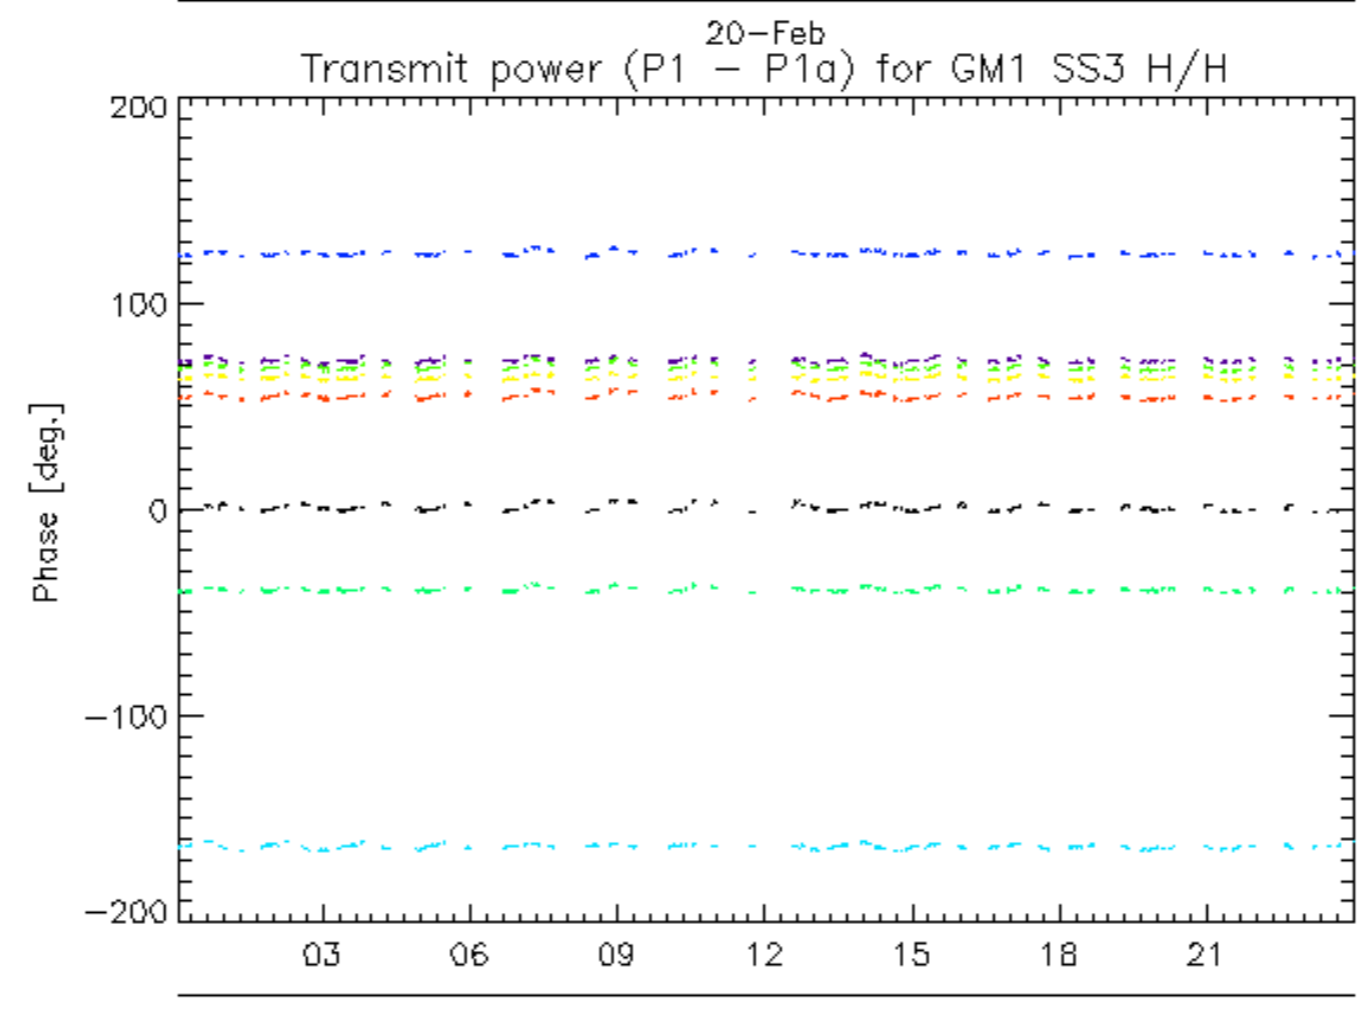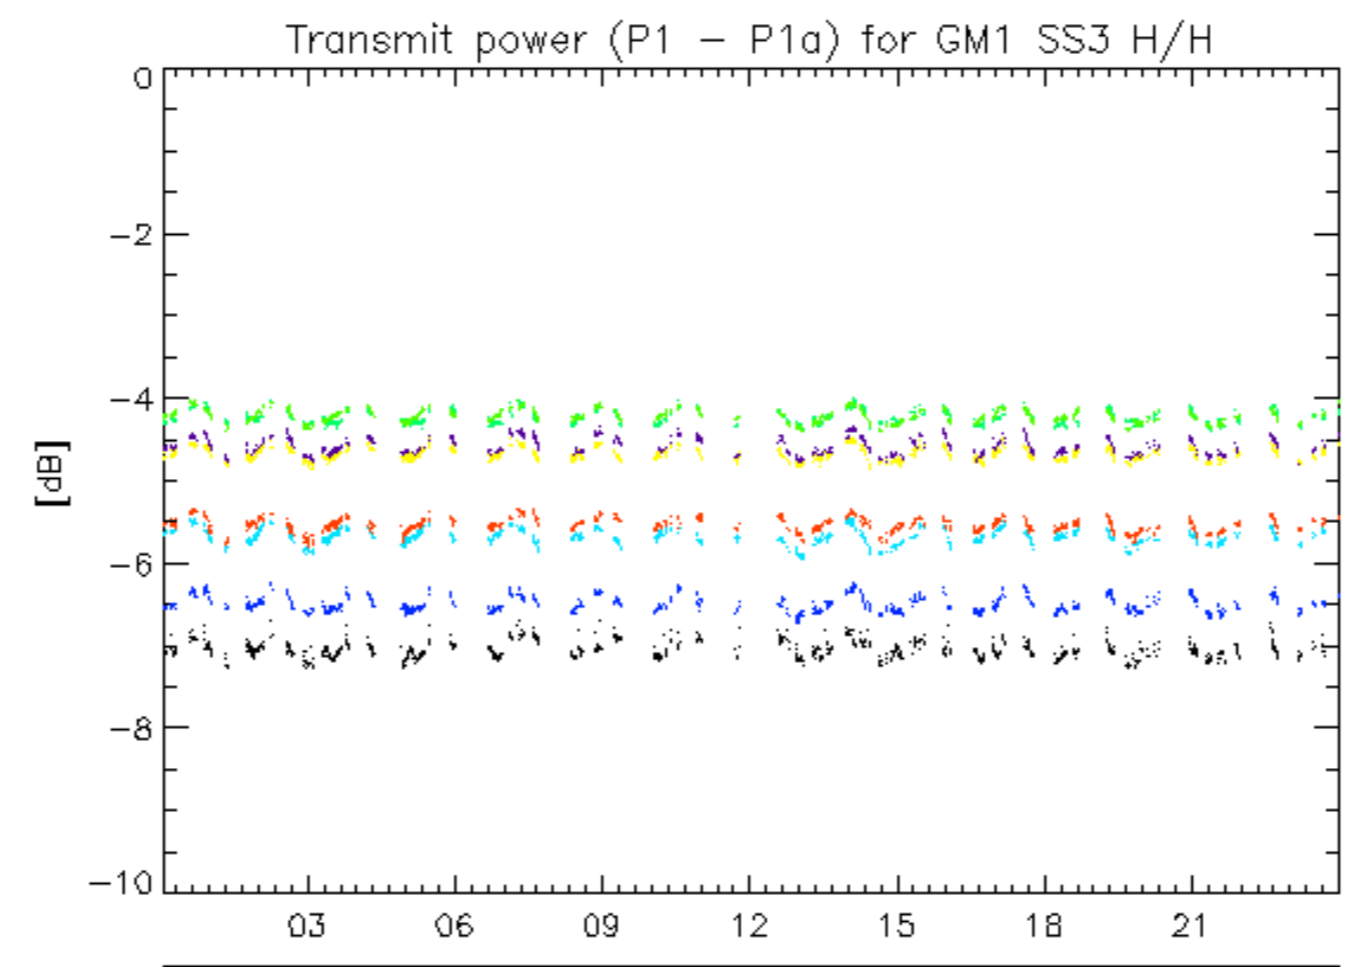



rows: _ 1 _ 13 _ 17 _ 21 _ 25 _ 29 _ 5 _ 9

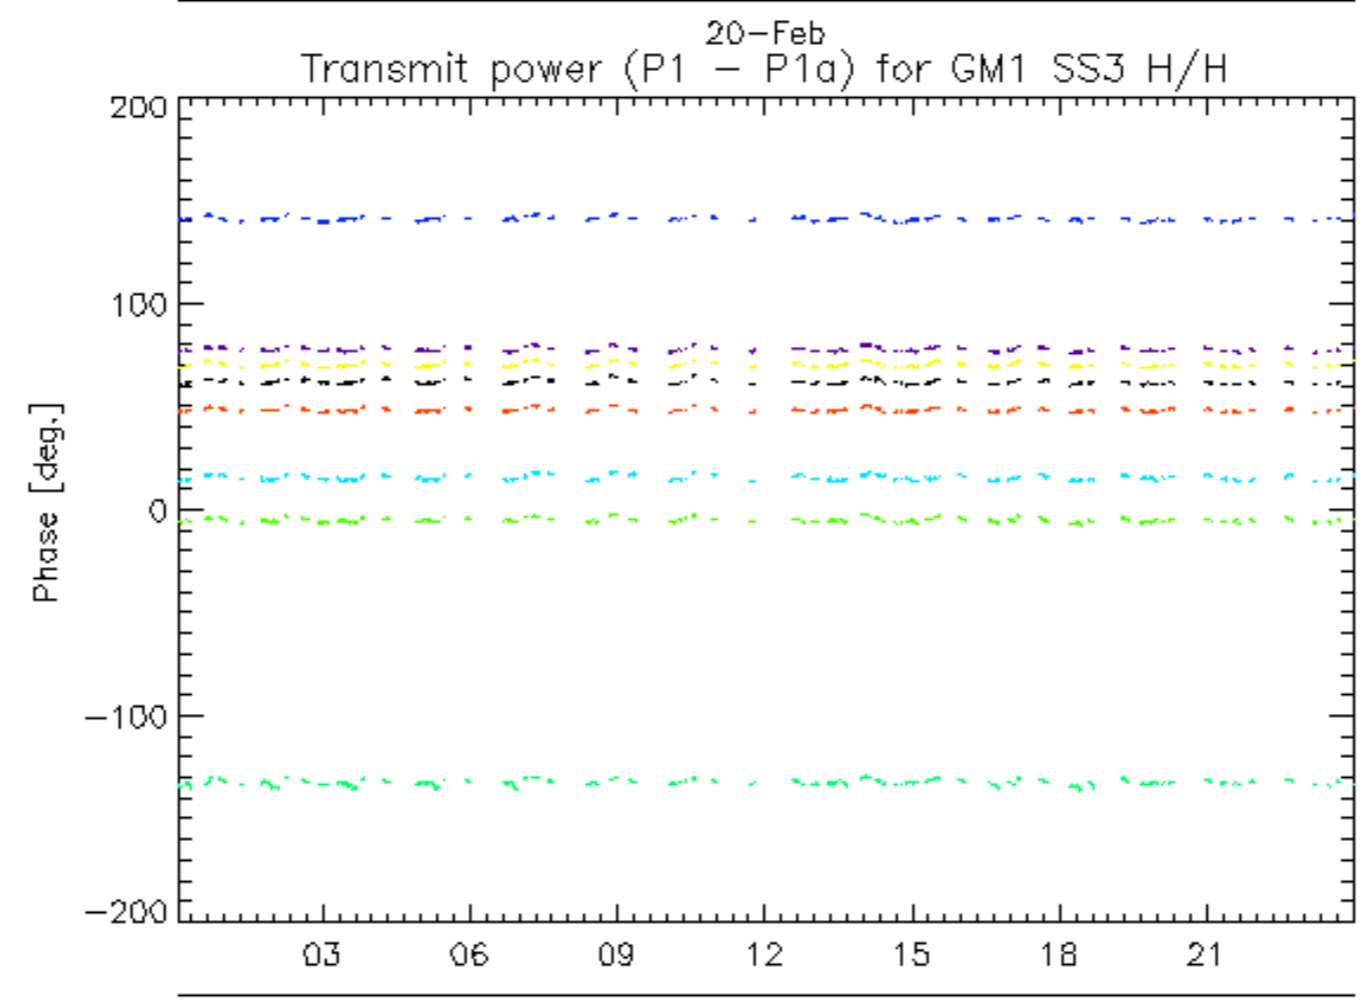
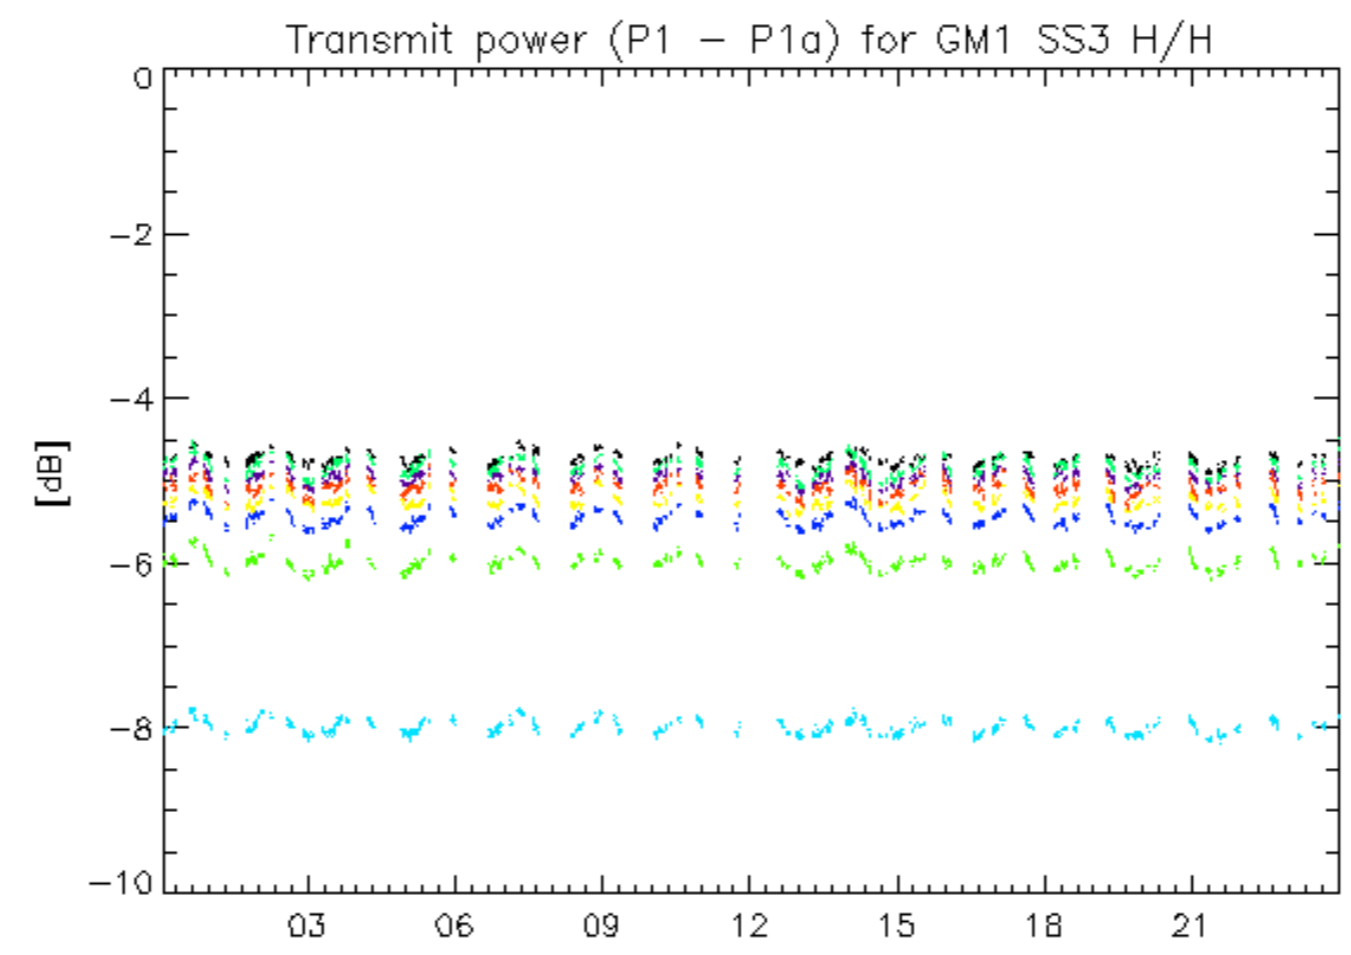




rows: _ 10 _ 14 _ 18 _ 2 _ 22 _ 26 _ 30 _ 6

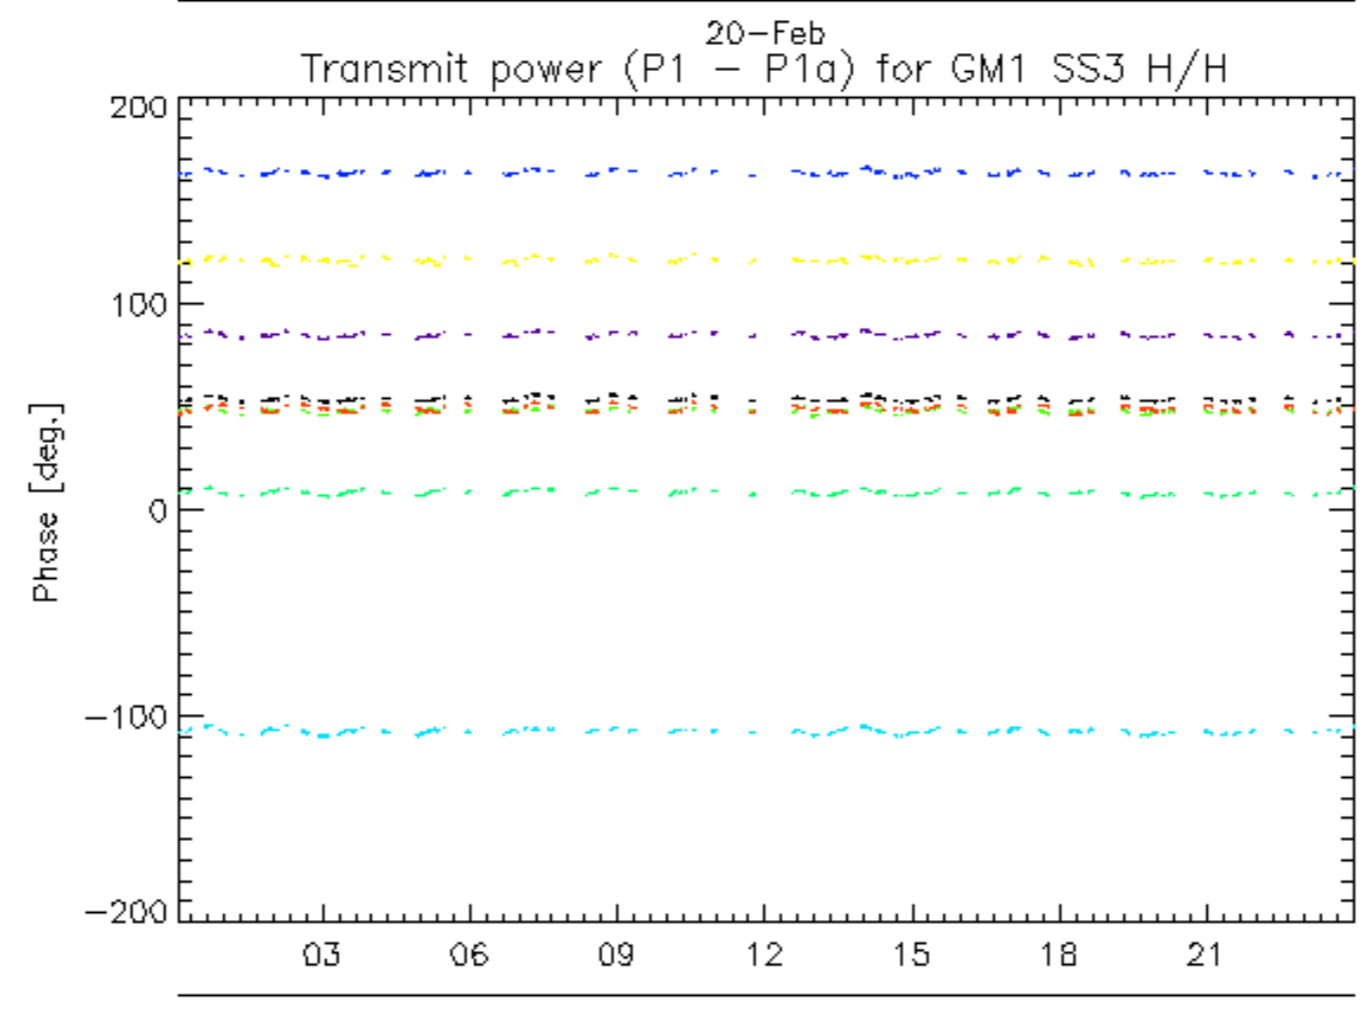
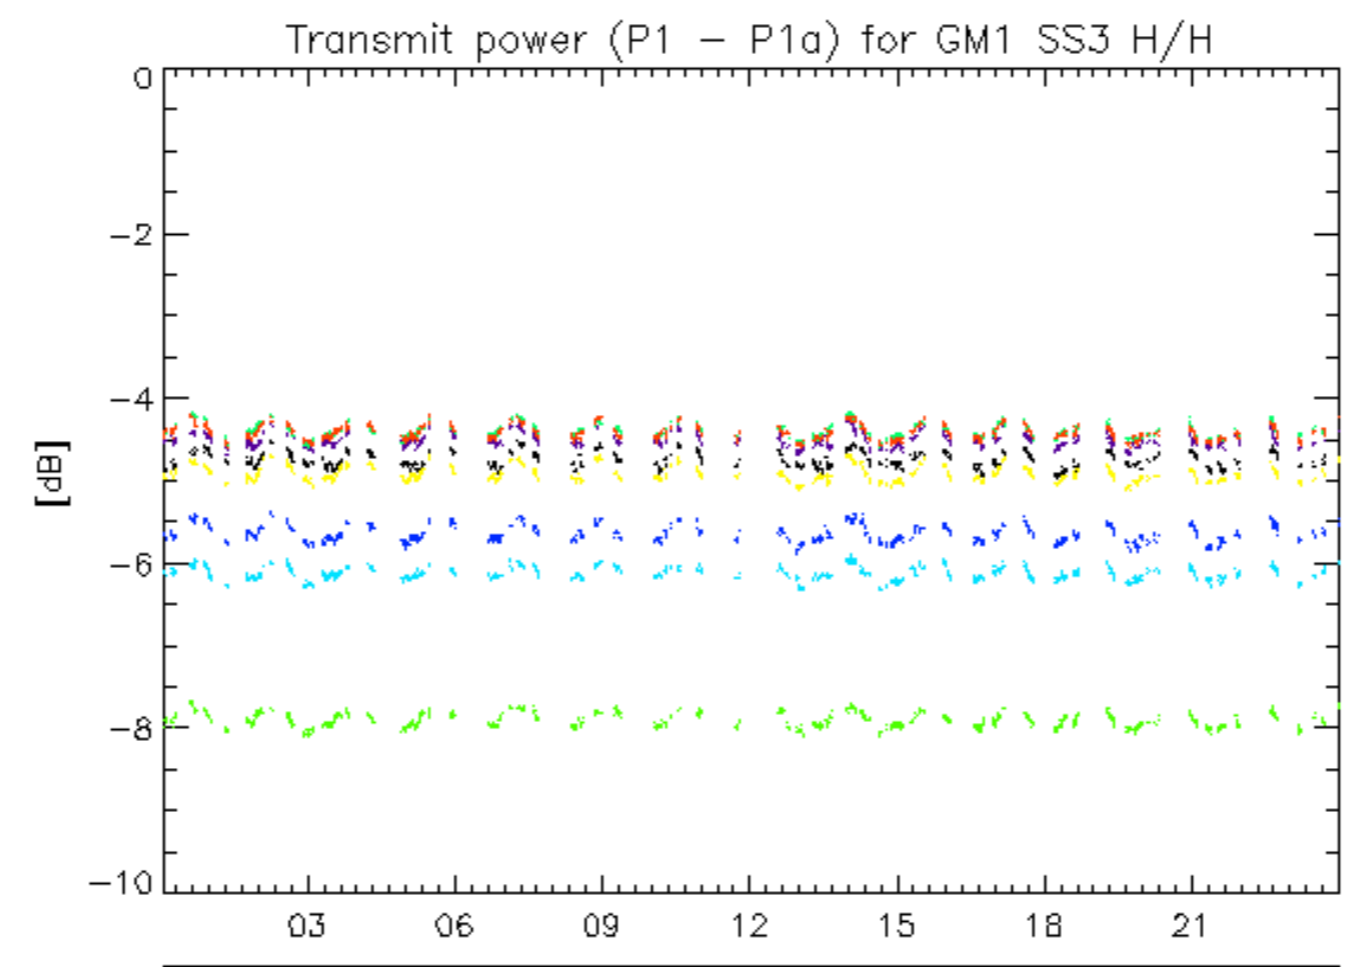


rows: _ 11 _ 15 _ 19 _ 23 _ 27 _ 31 _ 7

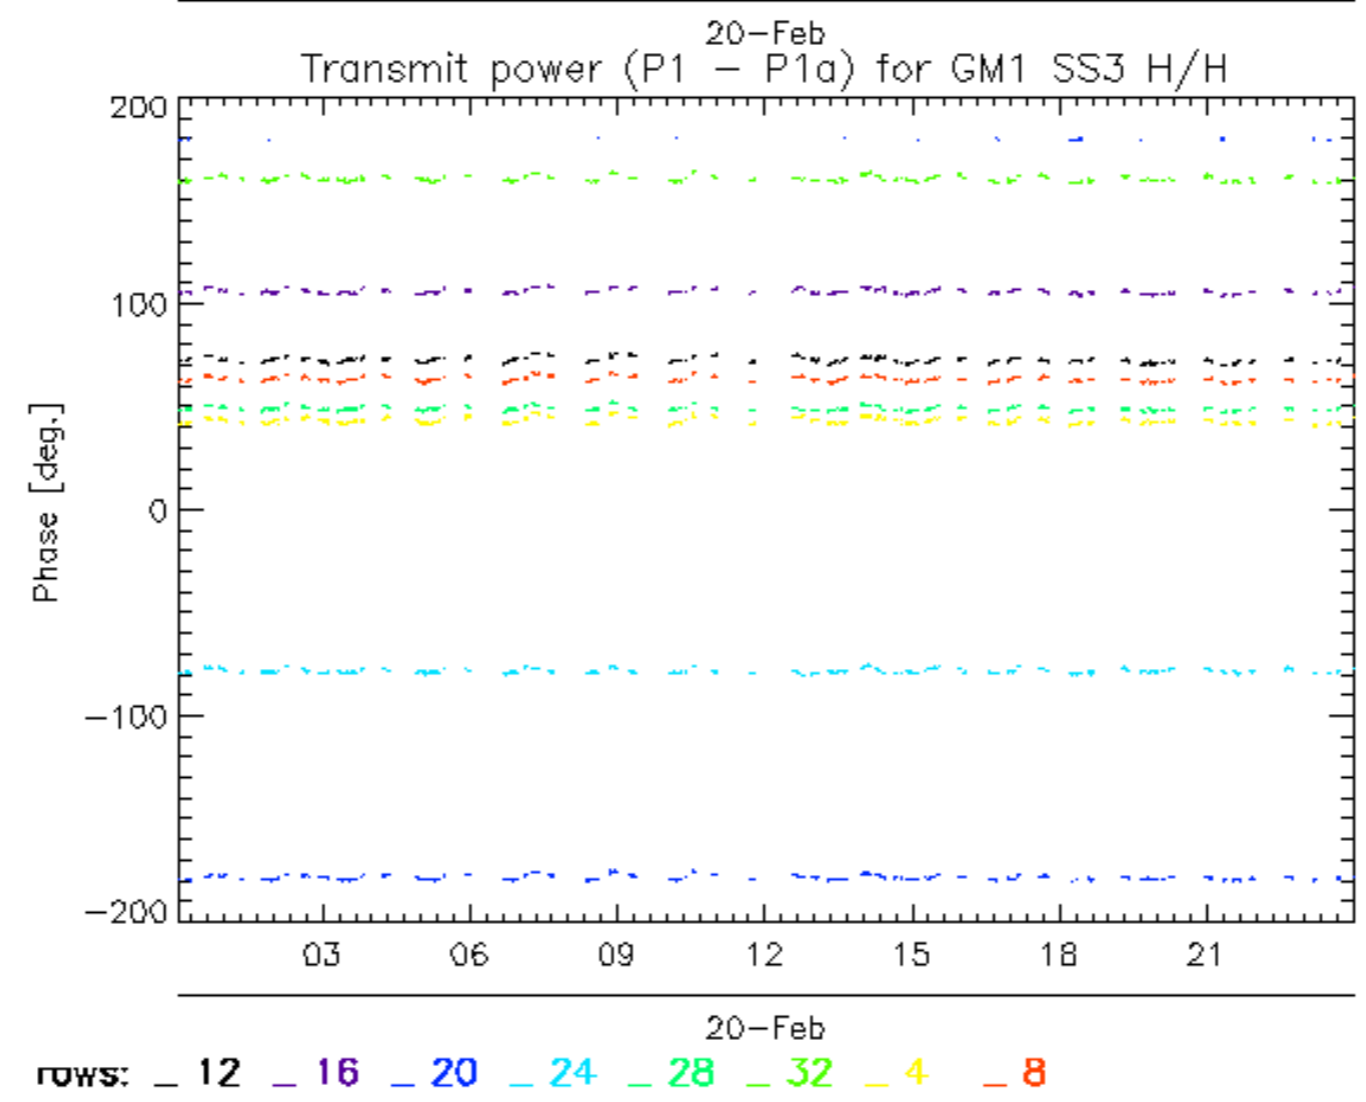
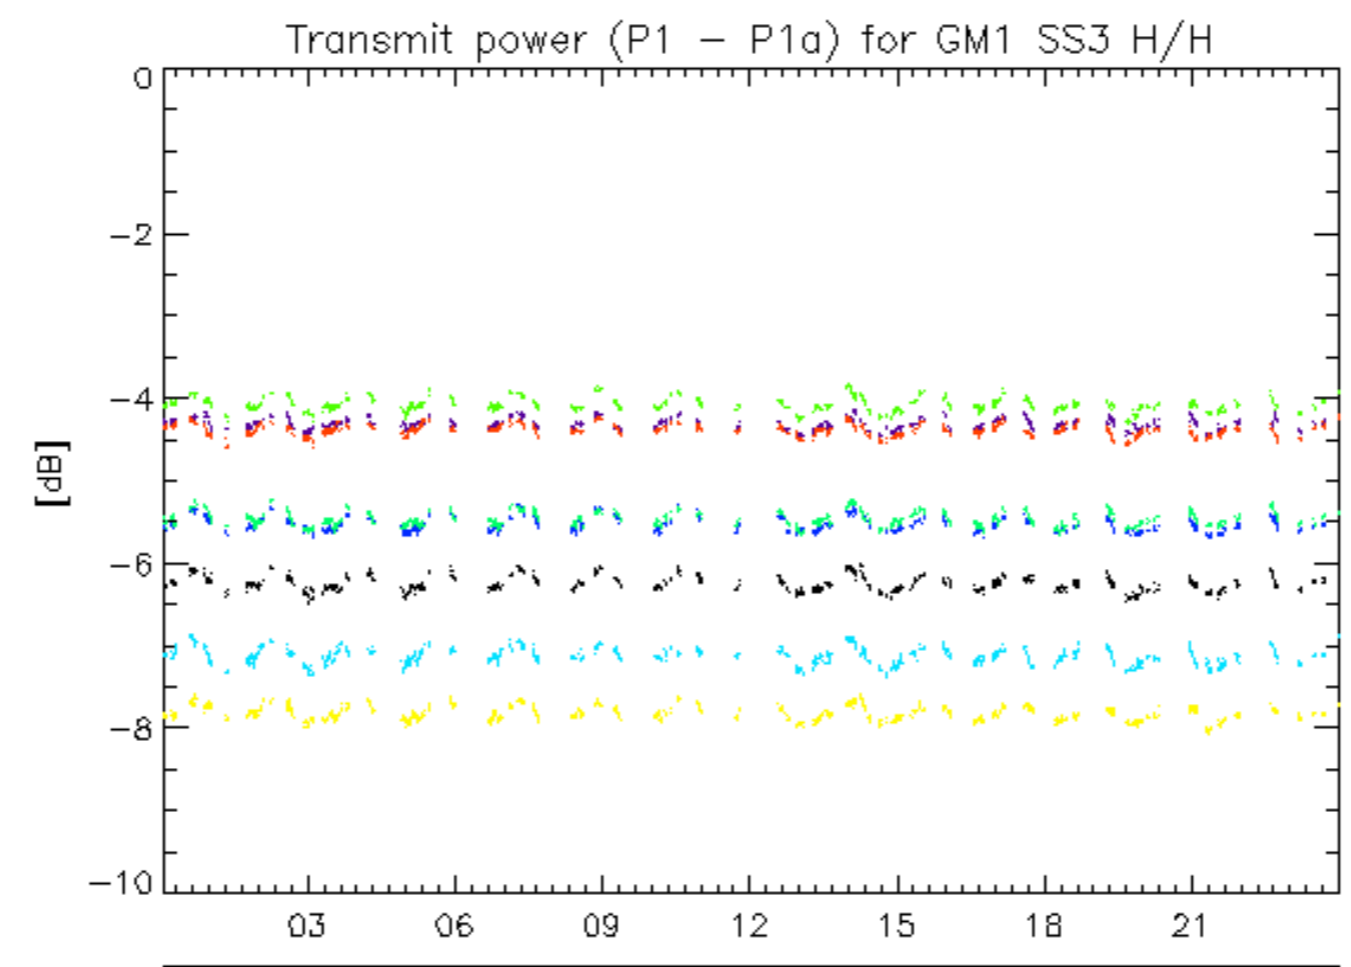


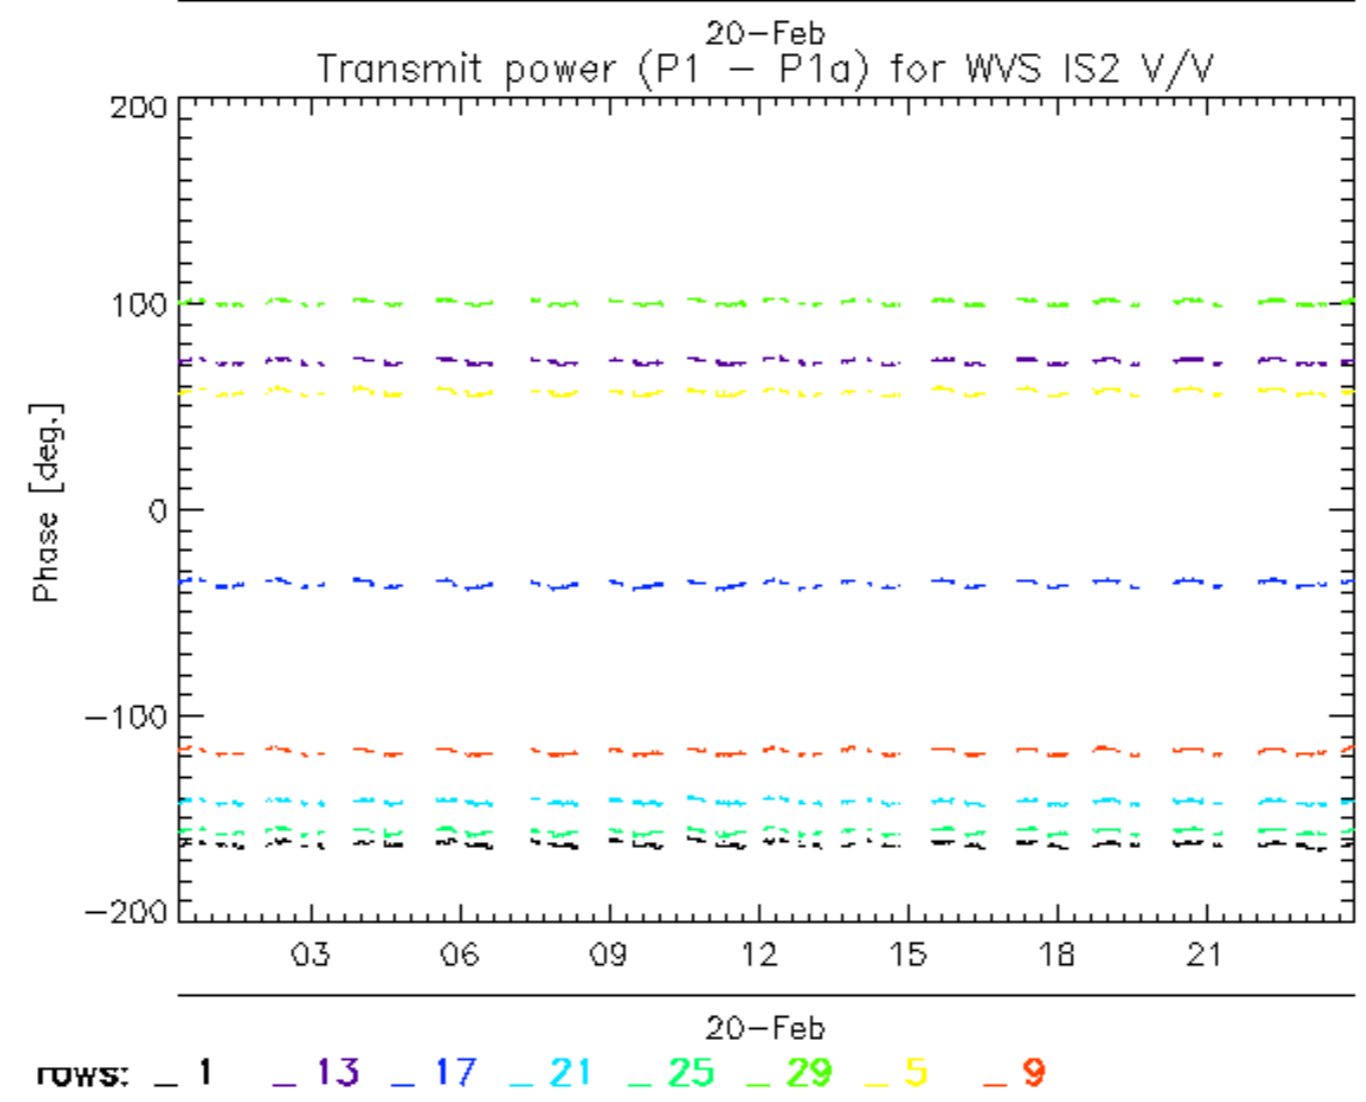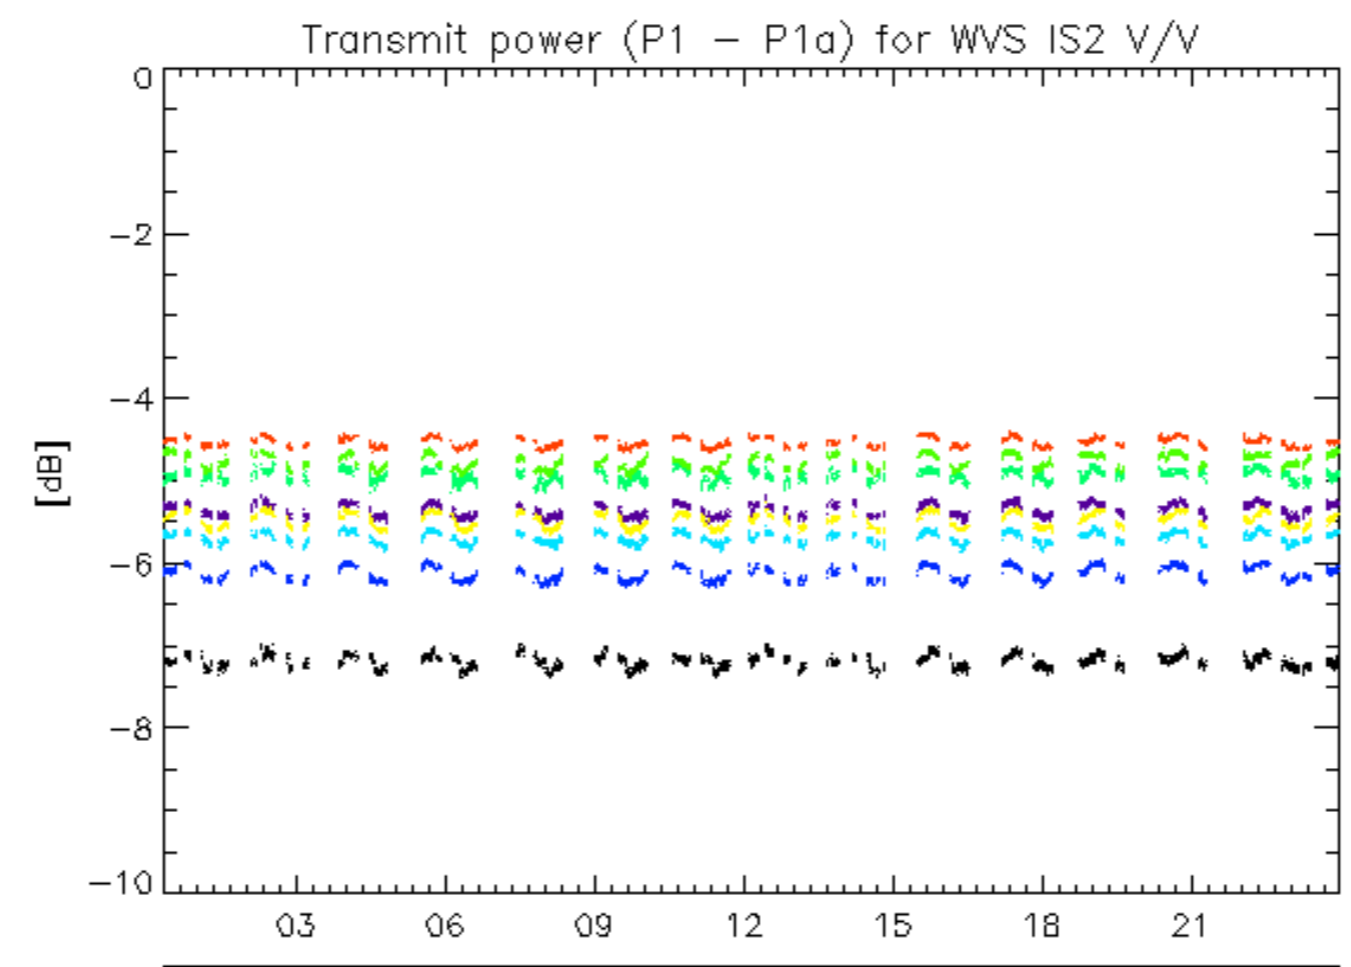

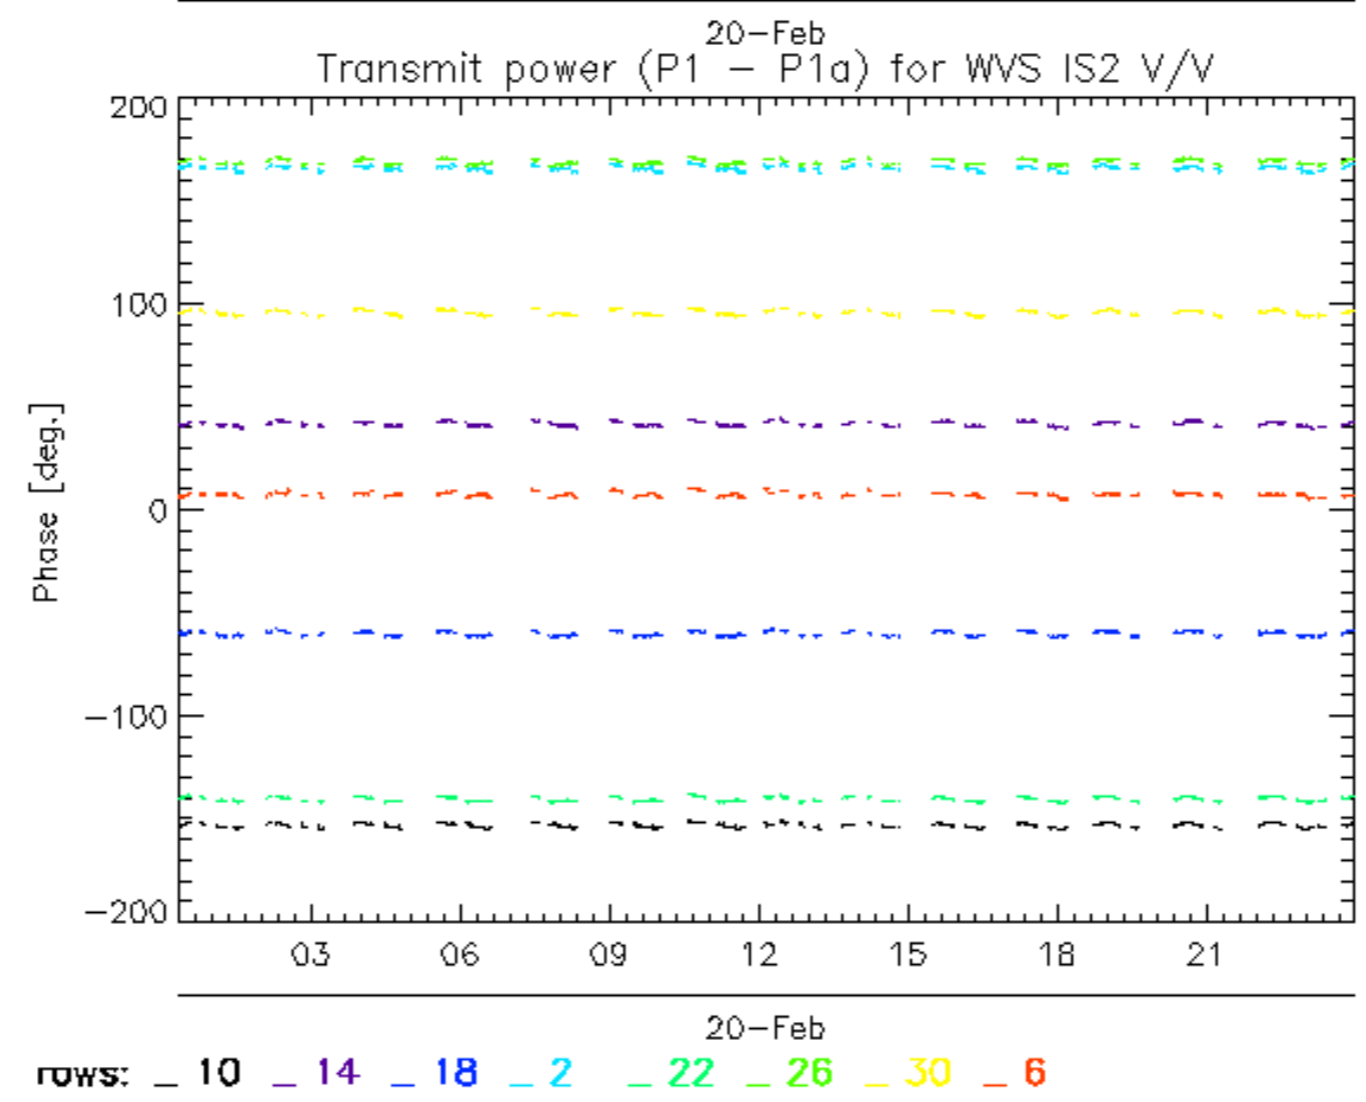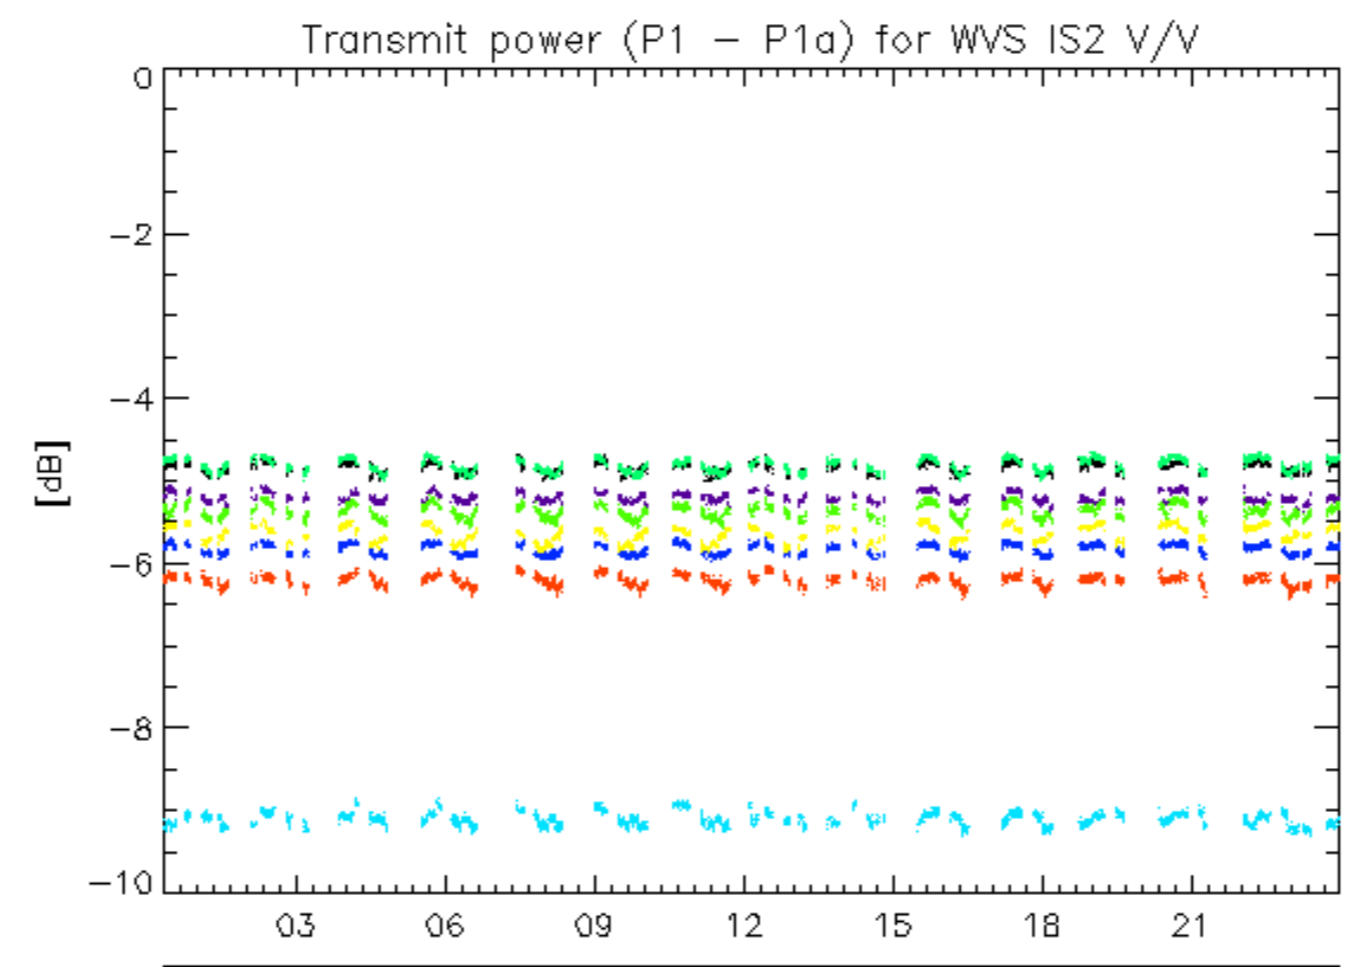


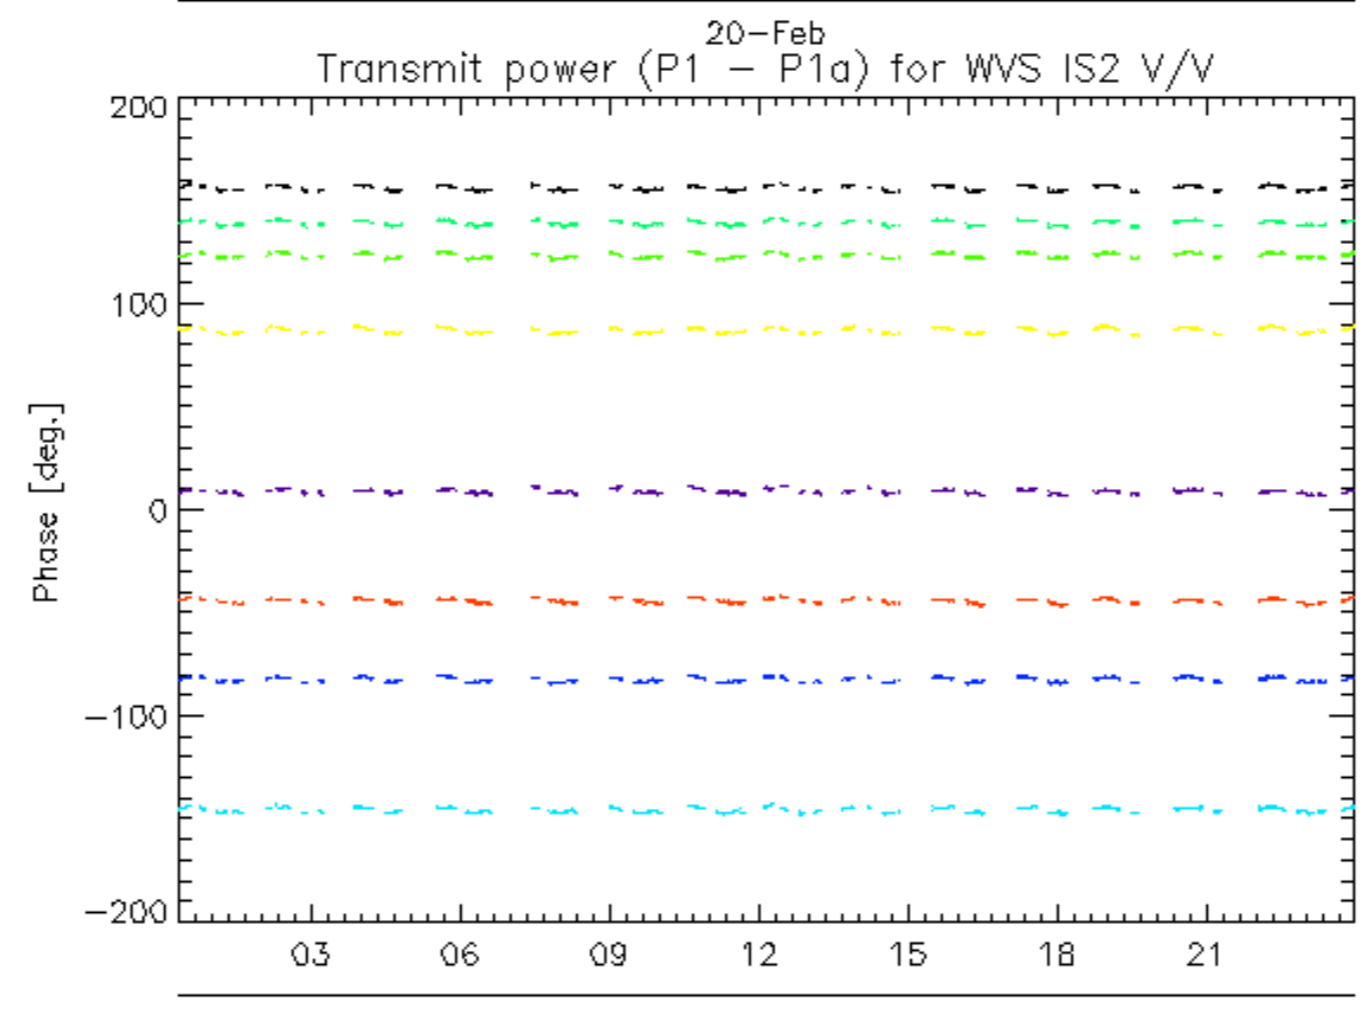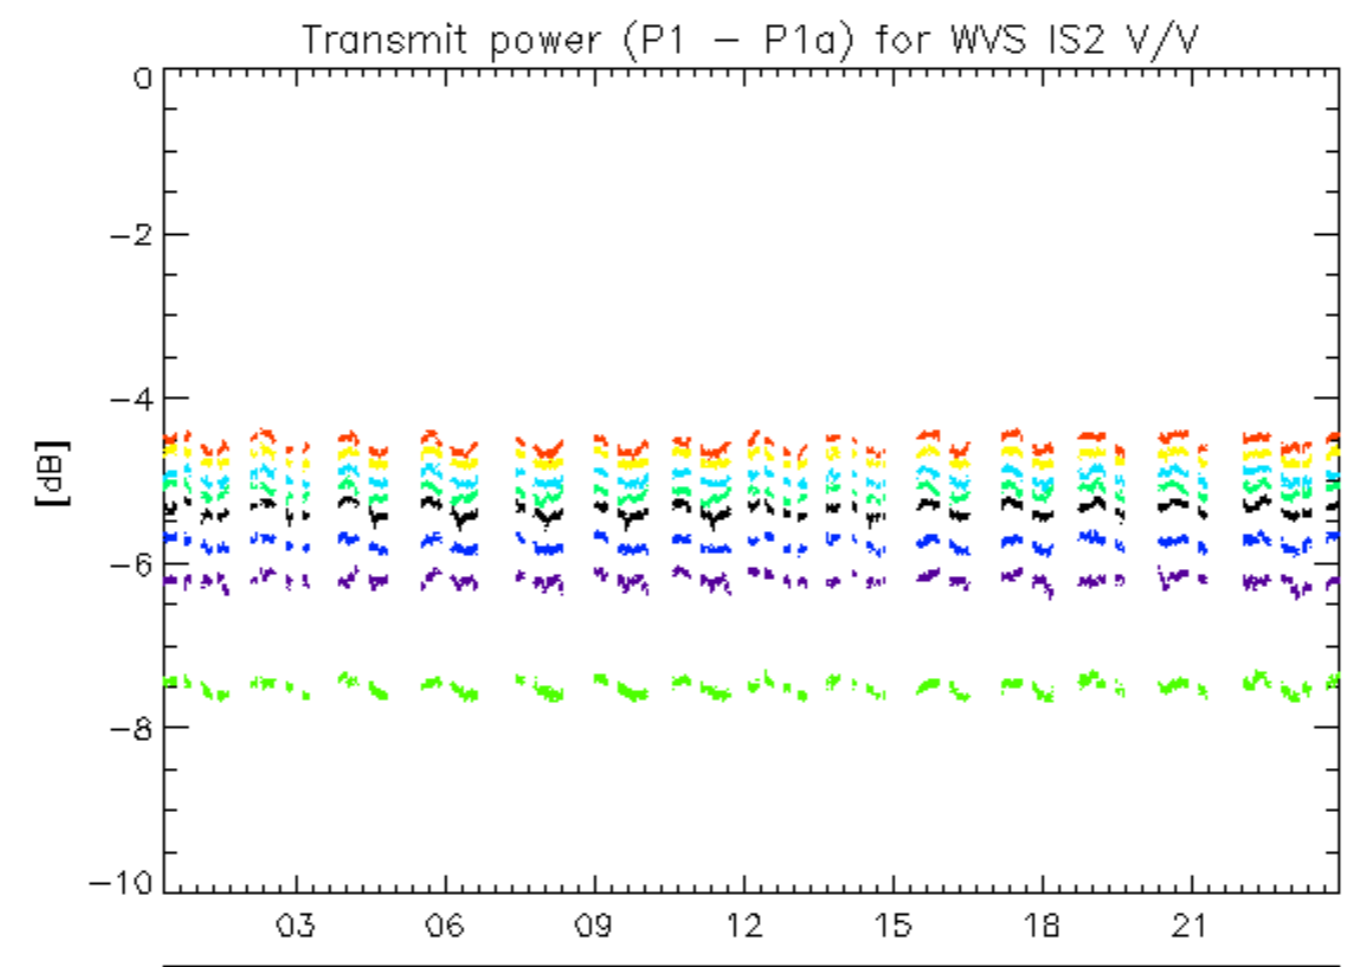



rows: _ 11 _ 15 _ 19 _ 23 _ 27 _ 3 _ 31 _ 7

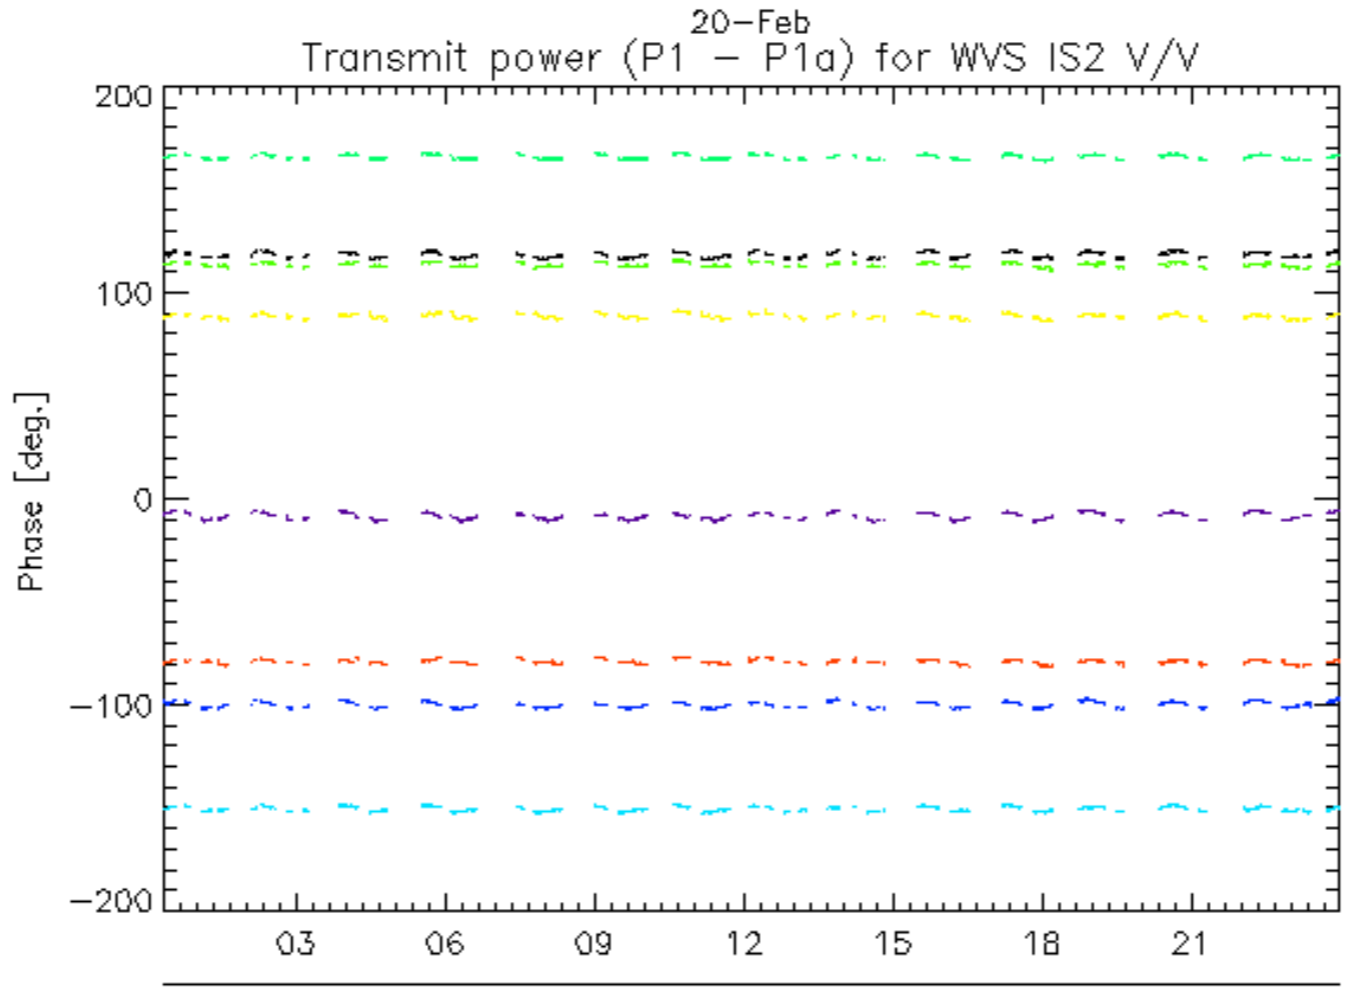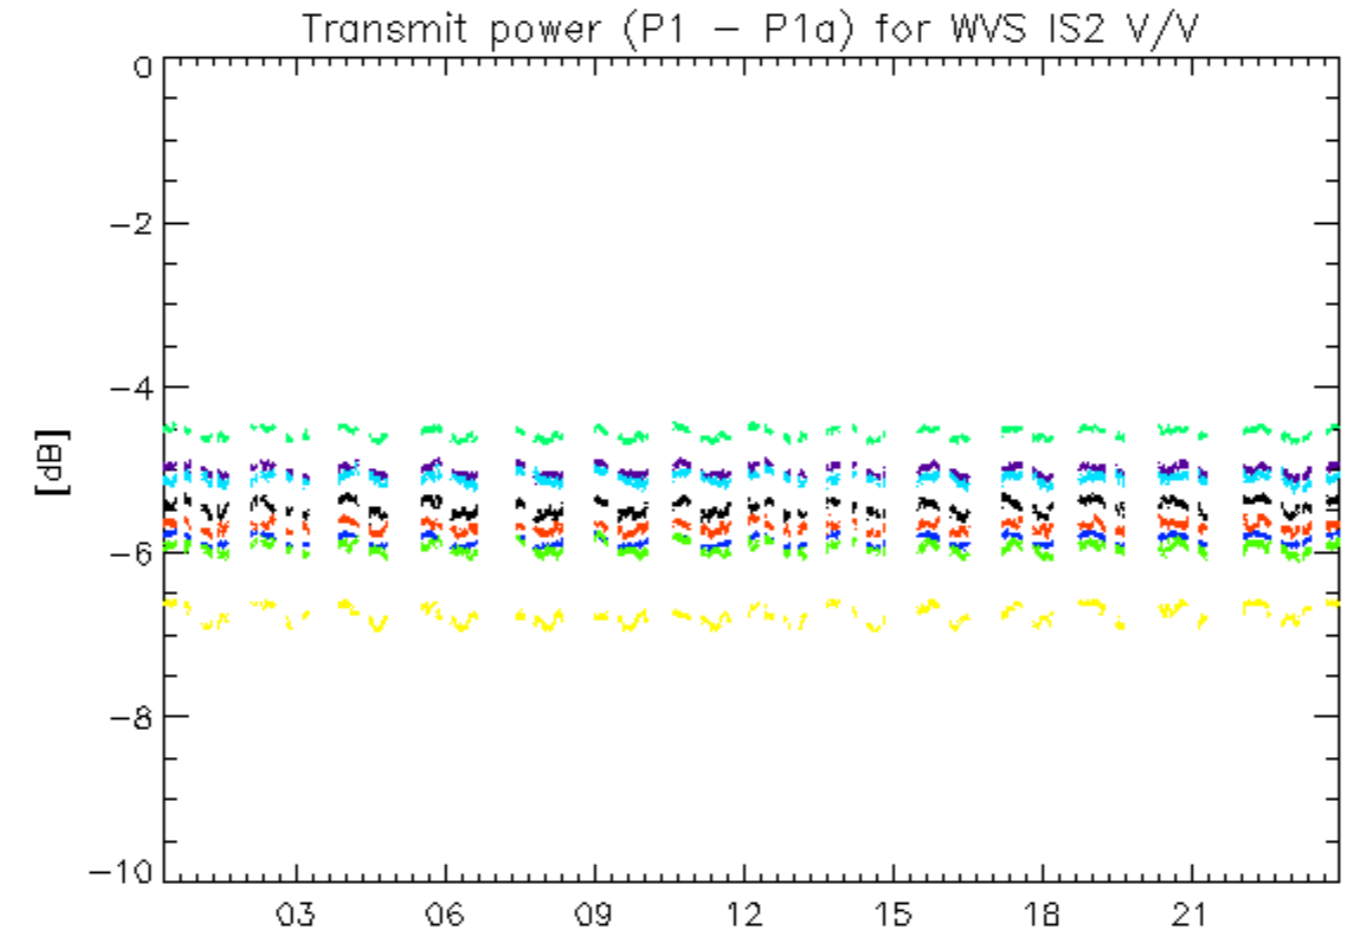


rows: _ 12 _ 16 _ 20 _ 24 _ 28 _ 32 _ 4 _ 8

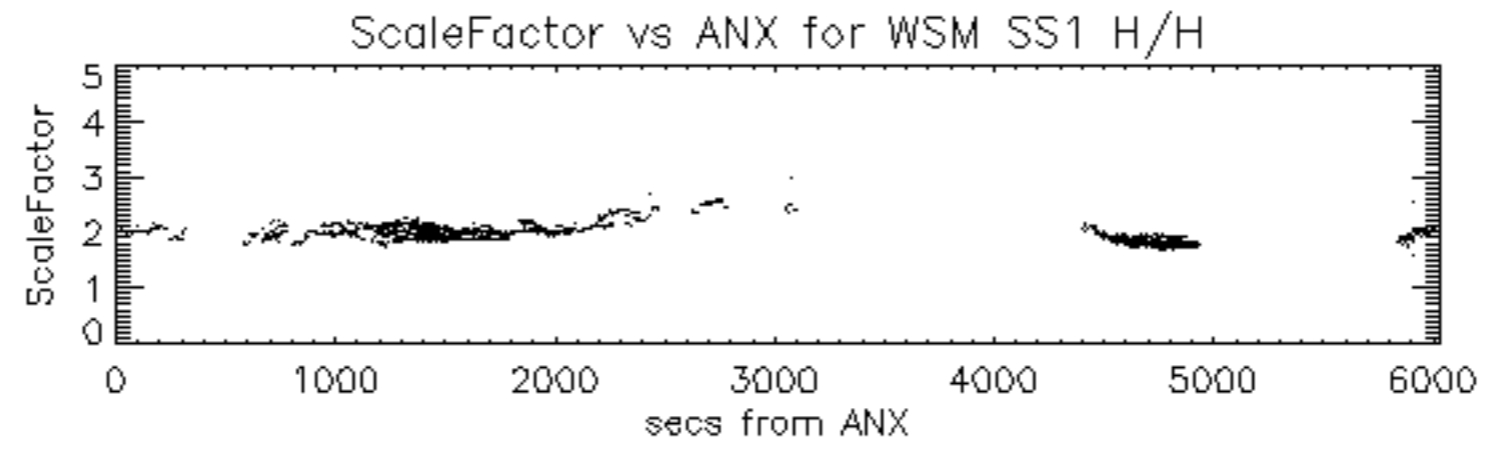

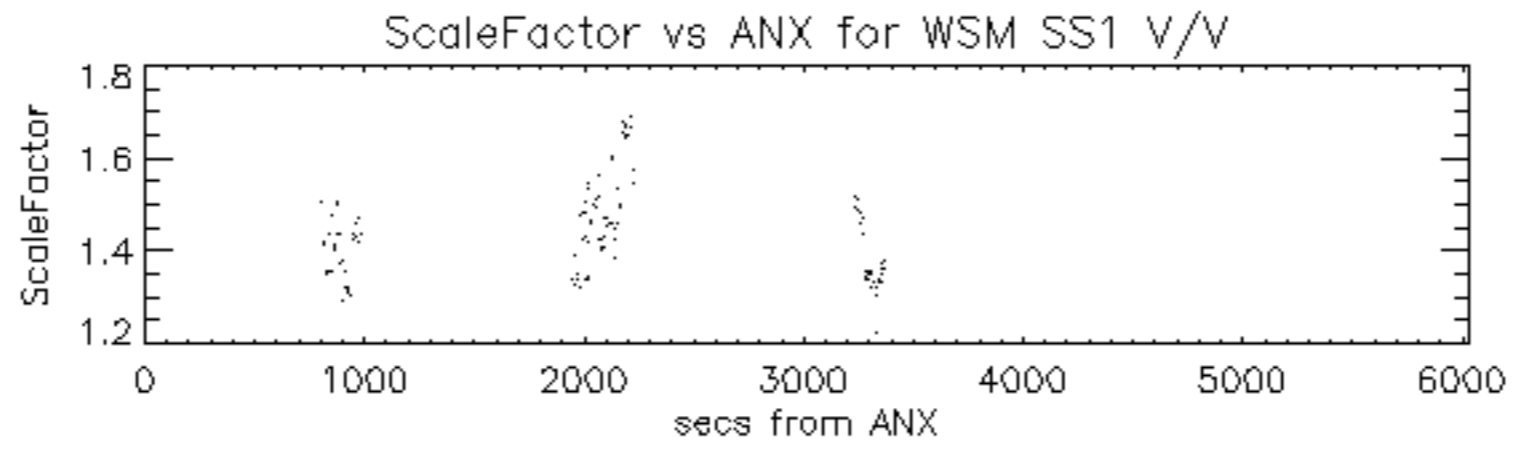

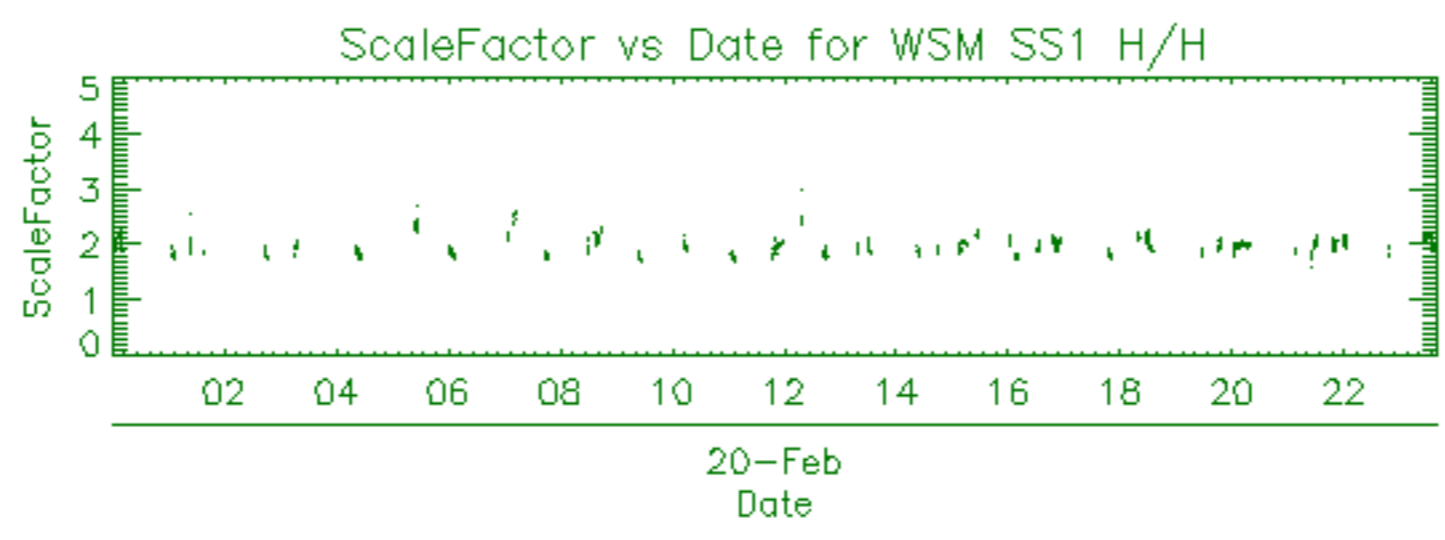

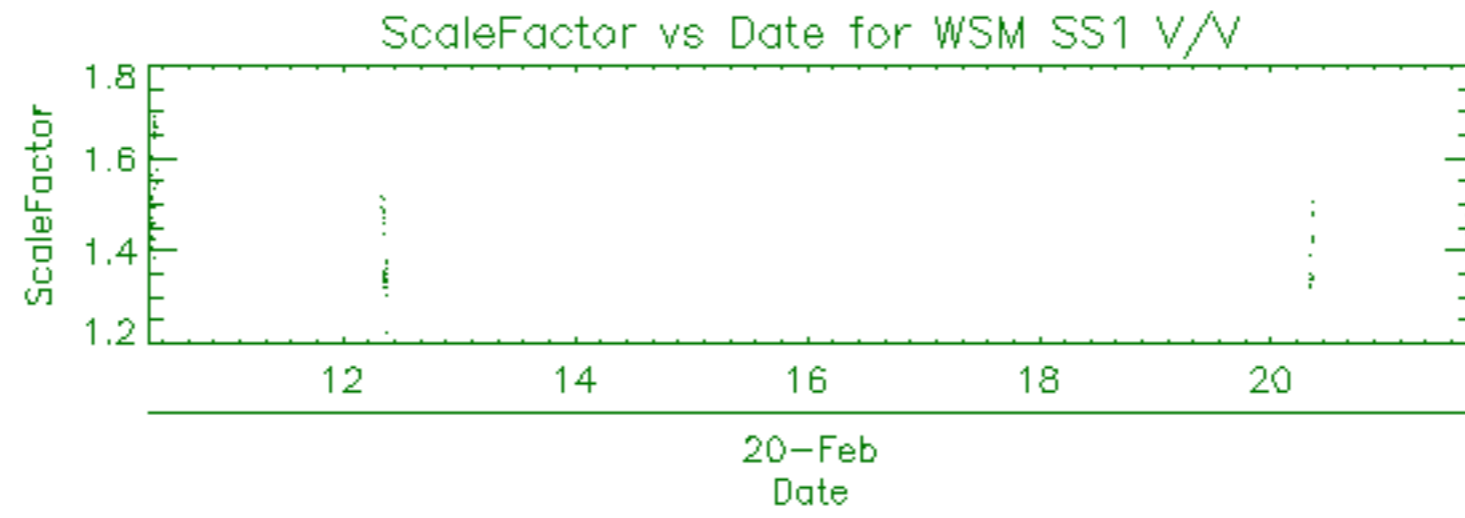



Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_APM_1PNPDE20120220_020744_000000793112_00003_52172_3336.N1						IS2	H/H	112	52172	3	5.04
ASA_APM_1PNPDE20120220_021334_000000833112_00003_52172_3339.N1						IS1	V/H	112	52172	3	5.04
ASA_APM_1PNPDE20120220_021648_000000573112_00003_52172_3338.N1						IS4	H/H	112	52172	3	5.04
ASA_APM_1PNPDE20120220_030226_000000853112_00003_52172_3341.N1						IS2	V/H	112	52172	3	5.04
ASA_APM_1PNPDE20120220_044951_000002653112_00005_52174_3400.N1						IS1	V/H	112	52174	5	5.04
ASA_APM_1PNPDE20120220_071820_000000433112_00006_52175_3444.N1						IS1	V/H	112	52175	6	5.04
ASA_APM_1PNPDE20120220_135430_000001333112_00010_52179_3586.N1						IS1	V/H	112	52179	10	5.04
ASA_APM_1PNPDE20120220_144542_000000443112_00010_52179_3589.N1						IS4	V/H	112	52179	10	5.04


ASA_GM1_1PNPDK20120220_183505_000004713112_00013_52182_9085.N1	SS1	H/H	112	52182	13	5.04
ASA_GM1_1PNPDK20120220_191601_000006283112_00013_52182_9088.N1	SS1	H/H	112	52182	13	5.04
ASA_GM1_1PNPDK20120220_194003_000002833112_00013_52182_9089.N1	SS1	H/H	112	52182	13	5.04
ASA_GM1_1PNPDK20120220_194856_000004413112_00014_52183_9090.N1	SS1	H/H	112	52183	14	5.04
ASA_GM1_1PNPDK20120220_195712_000002173112_00014_52183_9092.N1	SS1	H/H	112	52183	14	5.04
ASA_GM1_1PNPDE20120220_200615_000000843112_00014_52183_3679.N1	SS1	H/H	112	52183	14	5.04
ASA_GM1_1PNPDE20120220_201418_000001203112_00014_52183_3621.N1	SS1	H/H	112	52183	14	5.04
ASA_GM1_1PNPDE20120220_201846_000000723112_00014_52183_3625.N1	SS1	H/H	112	52183	14	5.04
ASA_GM1_1PNPDE20120220_205615_000006833112_00014_52183_3630.N1	SS1	H/H	112	52183	14	5.04
ASA_GM1_1PNPDE20120220_205615_000006833112_00014_52183_3628.N1	SS1	H/H	112	52183	14	5.04
ASA_GM1_1PNPDE20120220_211755_000004413112_00014_52183_3654.N1	SS1	H/H	112	52183	14	5.04
ASA_GM1_1PNPDE20120220_213212_000003503112_00015_52184_3655.N1	SS1	H/H	112	52184	15	5.04
ASA_GM1_1PNPDE20120220_213916_000001143112_00015_52184_3656.N1	SS1	H/H	112	52184	15	5.04
ASA_GM1_1PNPDE20120220_215327_000003023112_00015_52184_3659.N1	SS1	H/H	112	52184	15	5.04
ASA_GM1_1PNPDE20120220_223629_000006103112_00015_52184_3662.N1	SS1	H/H	112	52184	15	5.04
ASA_GM1_1PNPDE20120220_230942_000002953112_00016_52185_3674.N1	SS1	H/H	112	52185	16	5.04
ASA_GM1_1PNPDE20120220_232840_000001083112_00016_52185_3673.N1	SS1	H/H	112	52185	16	5.04
ASA_GM1_1PNPDE20120220_233939_000002413112_00016_52185_3677.N1	SS1	H/H	112	52185	16	5.04
ASA_GM1_1PNPDE20120220_235858_000001143112_00016_52185_3676.N1	SS1	H/H	112	52185	16	5.04


Filename	Beam	Pol	CycleNumber	absOrbit	relOrbit	procVersion					
ASA_IMM_1PNPDE20120220_025725_000000383112_00003_52172_3344.N1						IS5	V/V	112	52172	3	5.04
ASA_IMM_1PNPDE20120220_034138_000002633112_00004_52173_3337.N1						IS6	H/H	112	52173	4	5.04
ASA_IMM_1PNPDK20120220_065718_000002373112_00006_52175_8840.N1						IS6	H/H	112	52175	6	5.04
ASA_IMM_1PNPDE20120220_070444_000001123112_00006_52175_3433.N1						IS6	H/H	112	52175	6	5.04
ASA_IMM_1PNPDE20120220_071339_000000403112_00006_52175_3443.N1						IS7	V/V	112	52175	6	5.04
ASA_IMM_1PNPDE20120220_071438_000001053112_00006_52175_3445.N1						IS2	V/V	112	52175	6	5.04
ASA_IMM_1PNPDE20120220_084446_000000533112_00007_52176_3493.N1						IS6	H/H	112	52176	7	5.04
ASA_IMM_1PNPDE20120220_102523_000000373112_00008_52177_3496.N1						IS2	V/V	112	52177	8	5.04
ASA_IMM_1PNPDE20120220_102759_000002153112_00008_52177_3497.N1						IS6	H/H	112	52177	8	5.04
ASA_IMM_1PNPDE20120220_111426_000000993112_00008_52177_3500.N1						IS6	H/H	112	52177	8	5.04
ASA_IMM_1PNPDK20120220_131504_000000373112_00010_52179_8983.N1						IS2	V/V	112	52179	10	5.04
ASA_IMM_1PNPDE20120220_152402_000000393112_00011_52180_3590.N1						IS3	H/H	112	52180	11	5.04
ASA_IMM_1PNPDE20120220_170607_000001703112_00012_52181_3607.N1						IS6	H/H	112	52181	12	5.04
ASA_IMM_1PNPDE20120220_203153_000000433112_00014_52183_3640.N1						IS2	V/V	112	52183	14	5.04




Filename	Pol	Timestamp	count(Module)
ASA_MS__0PNPDE20120220_005156_000000163112_00002_52171_0472.N1	V	2012-02-20 00:51:56	320
ASA_MS__0PNPDE20120220_223457_000000163112_00015_52184_0473.N1	H	2012-02-20 22:34:57	320



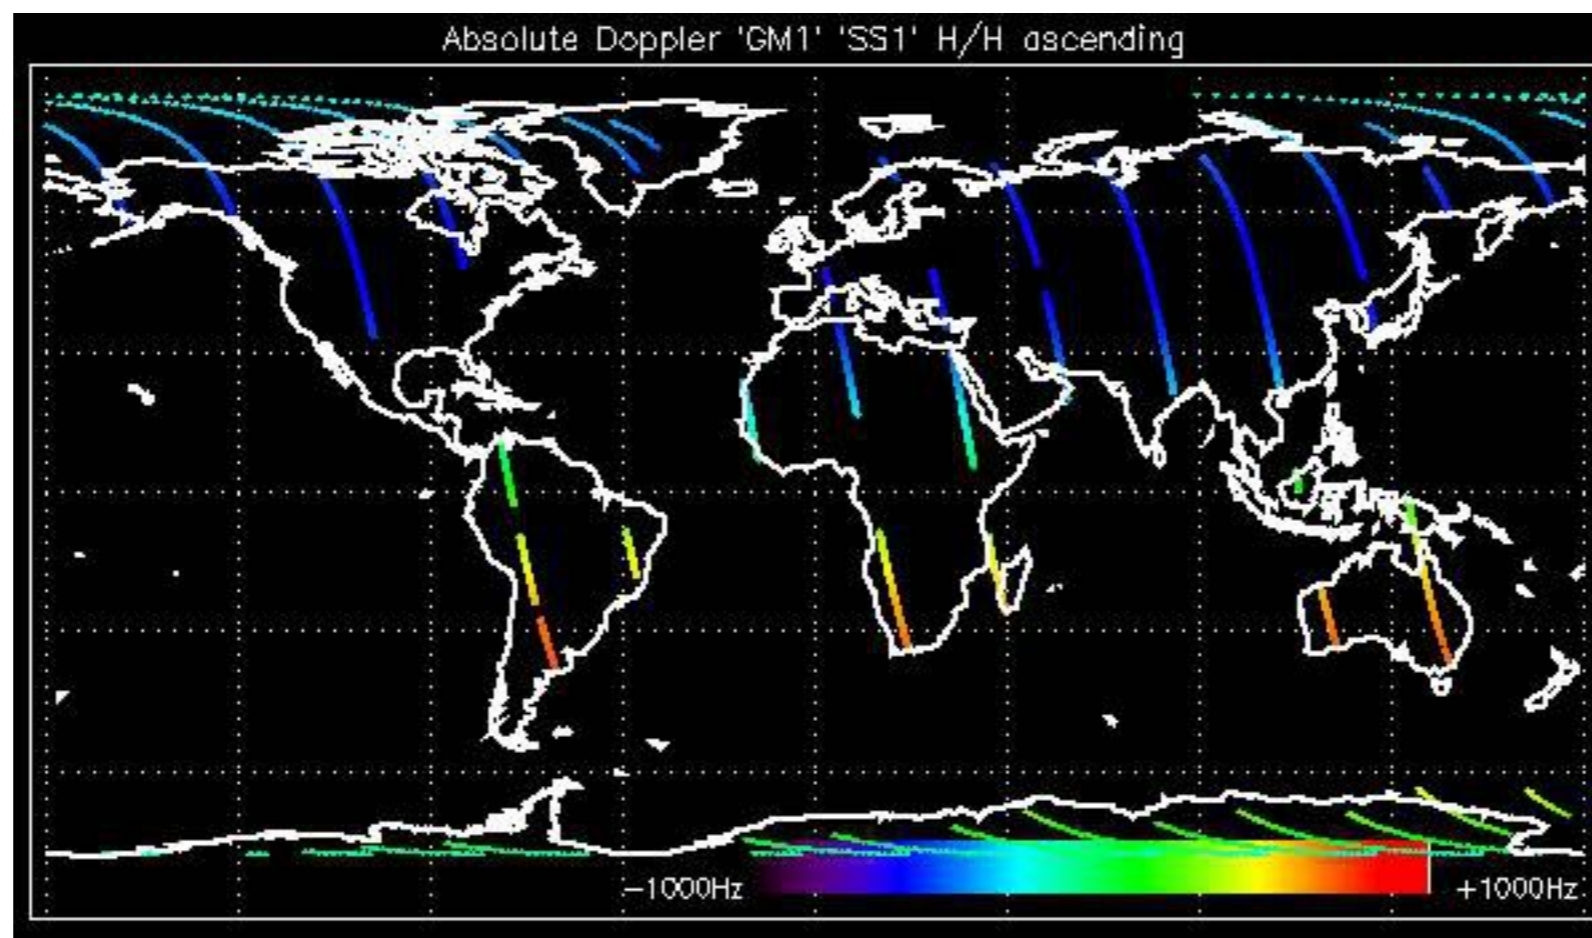


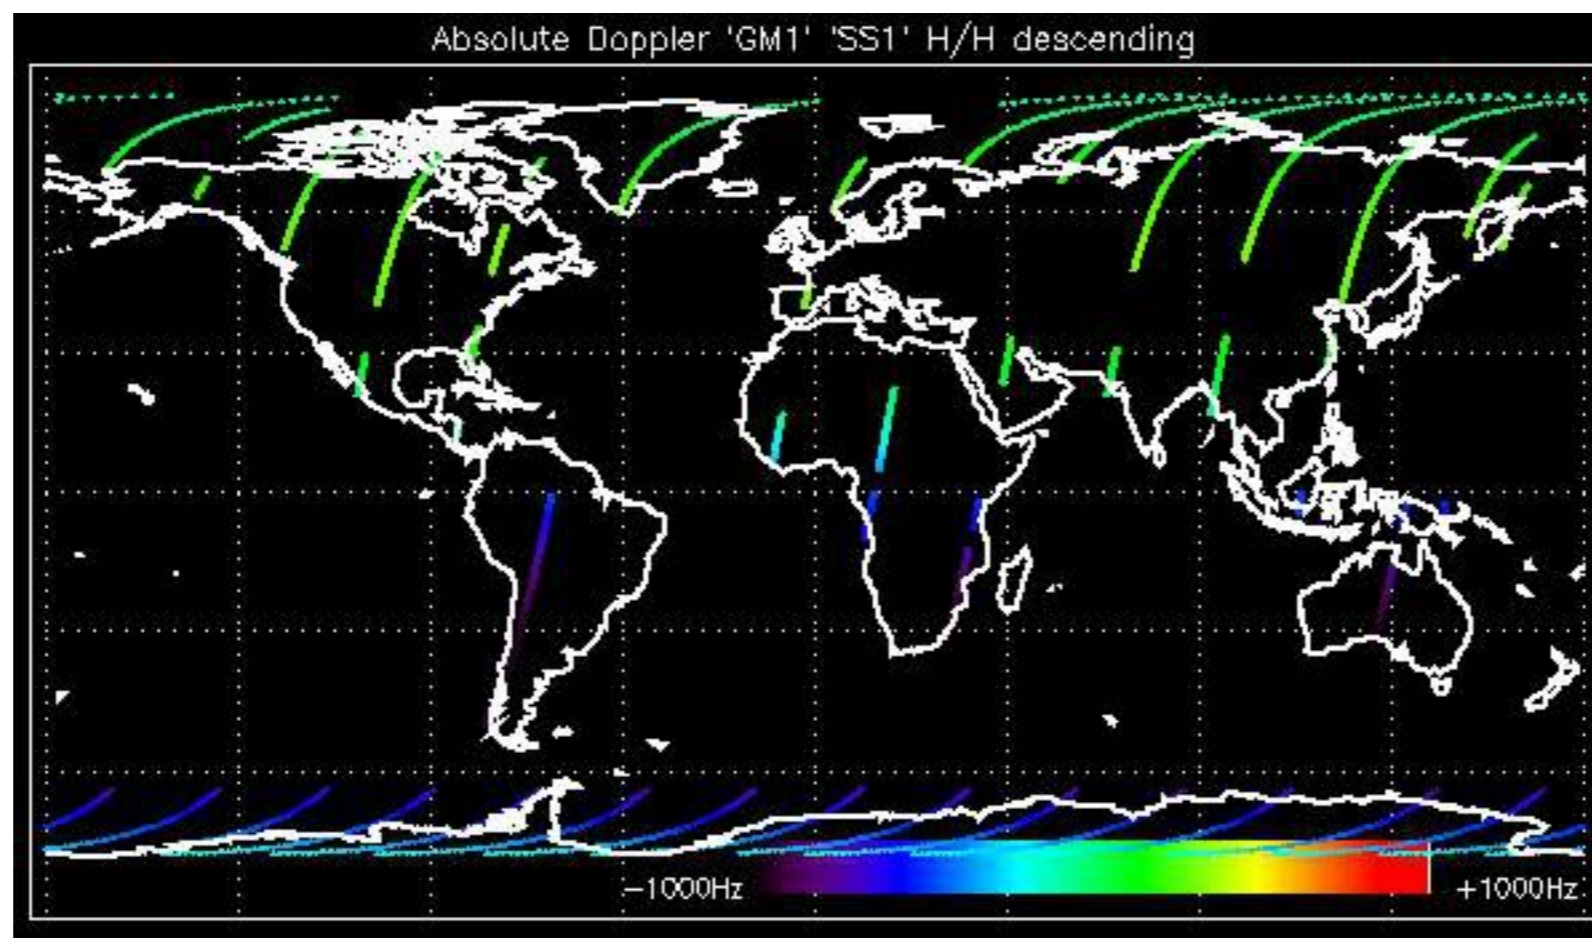


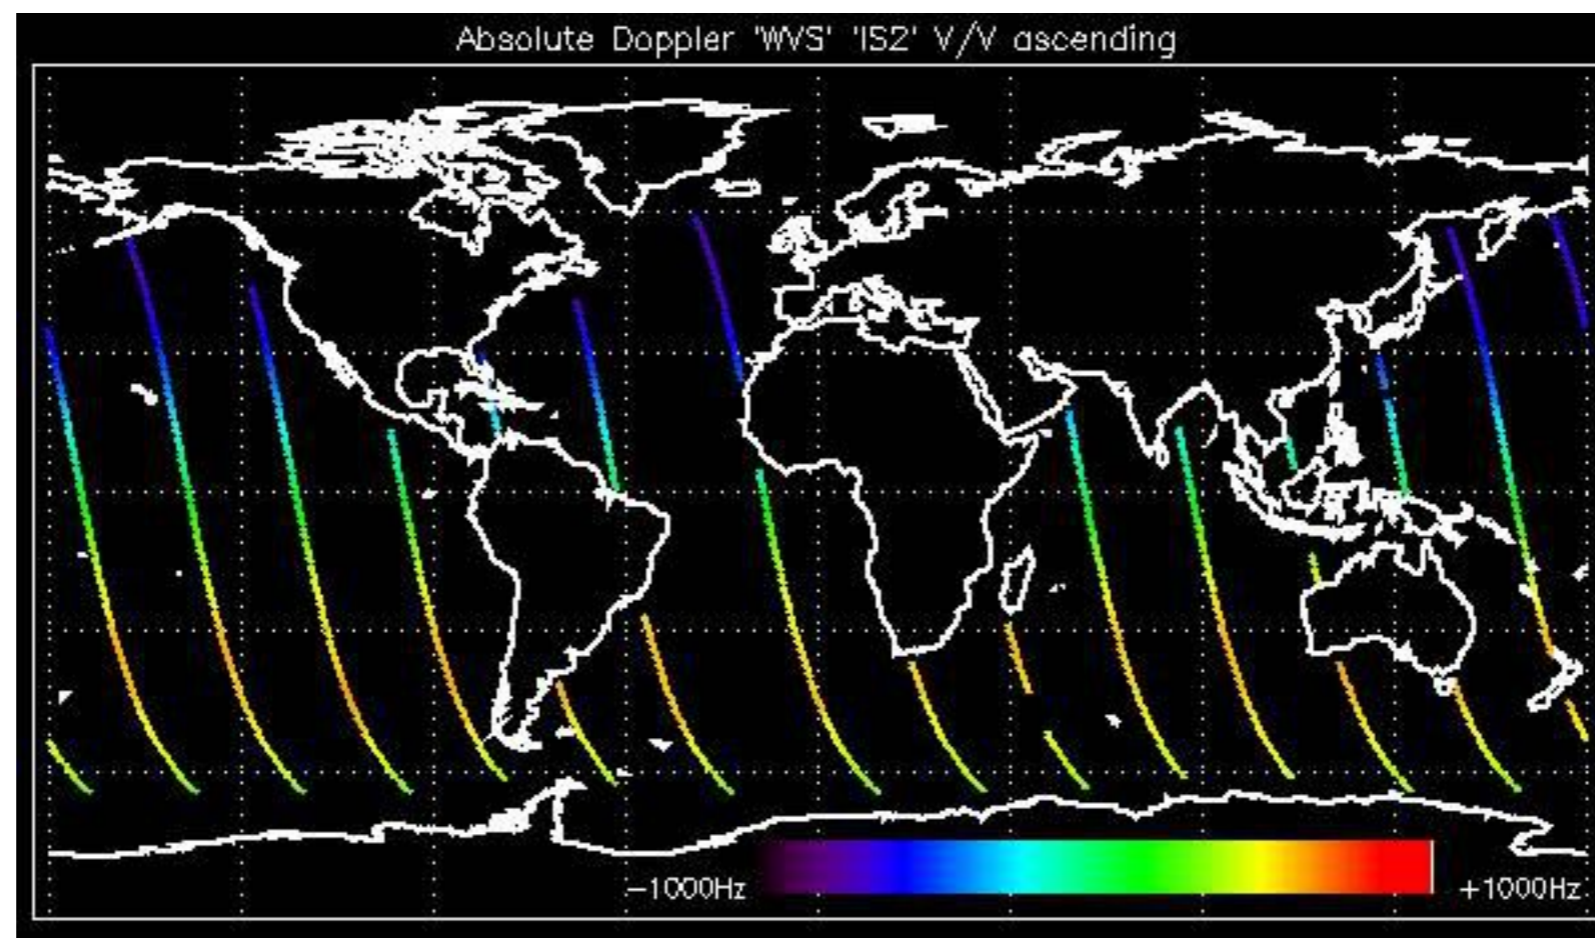


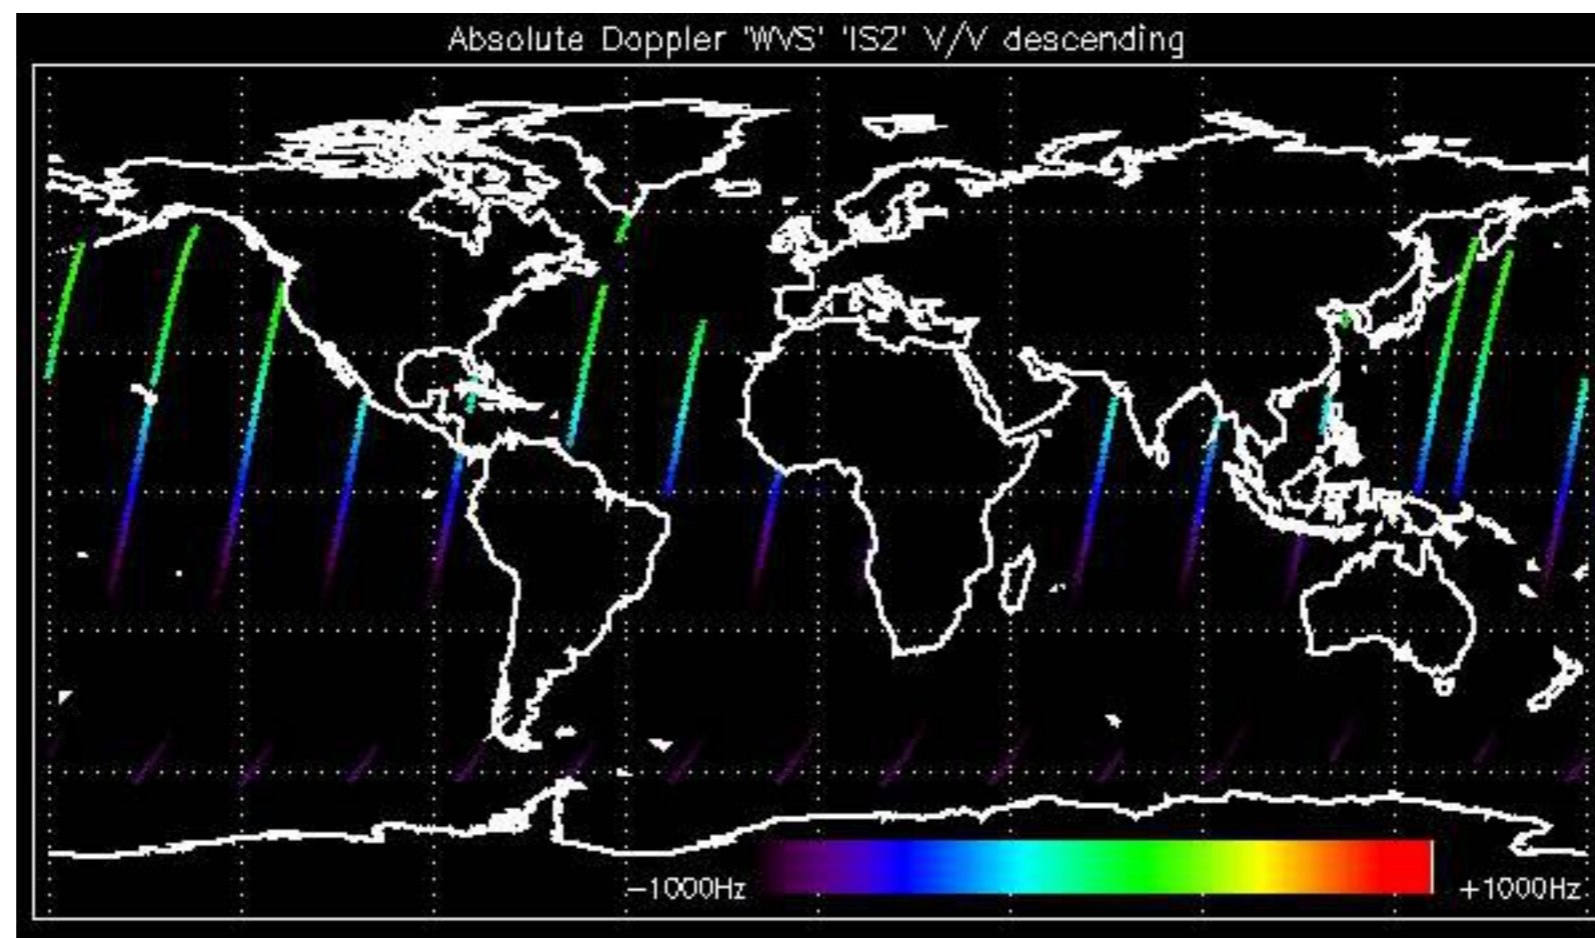


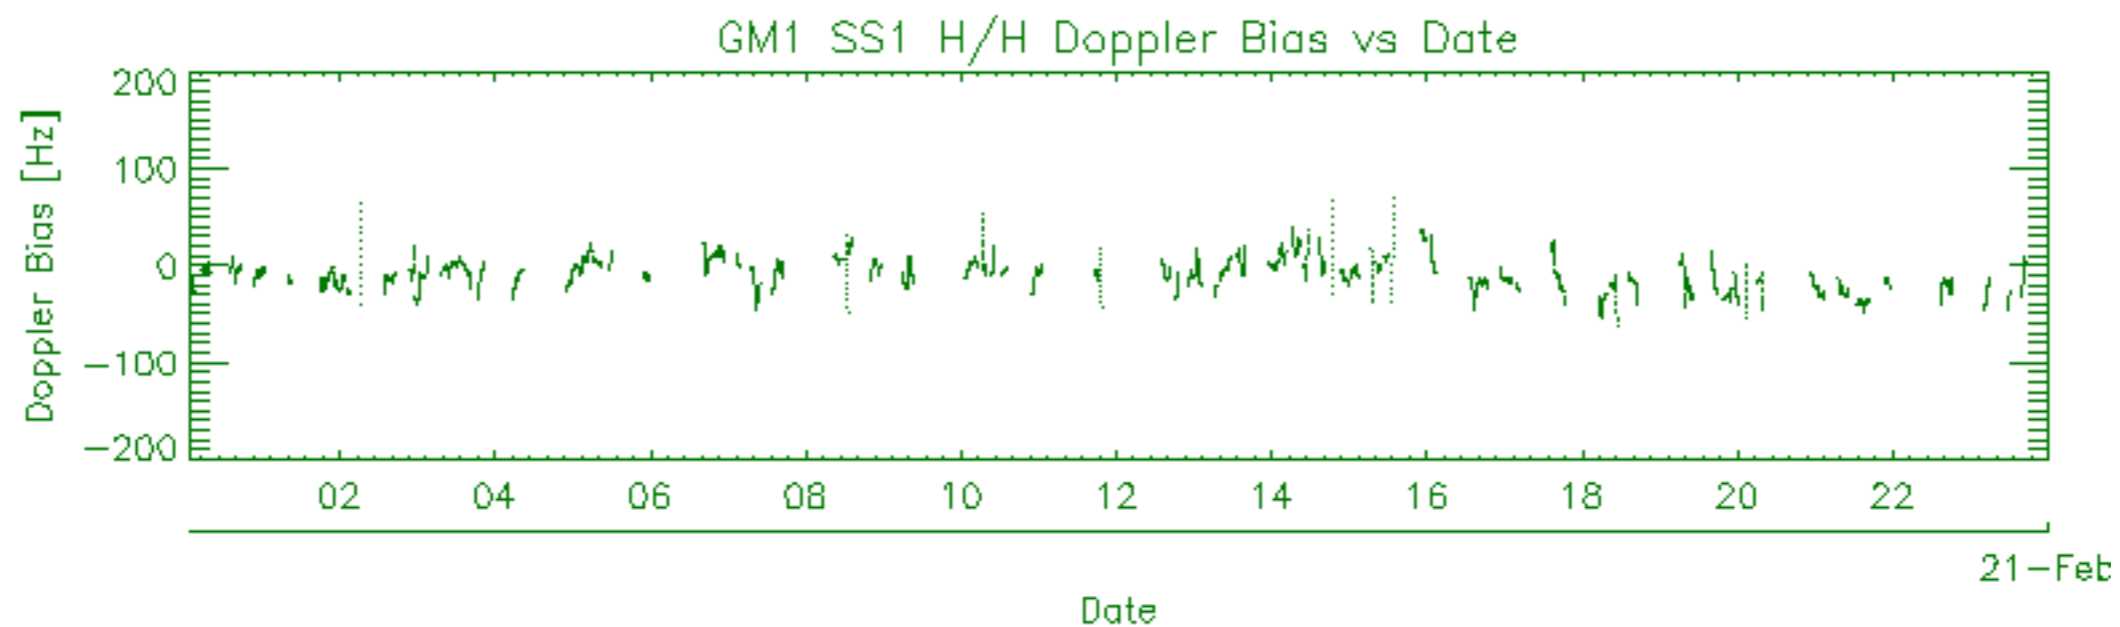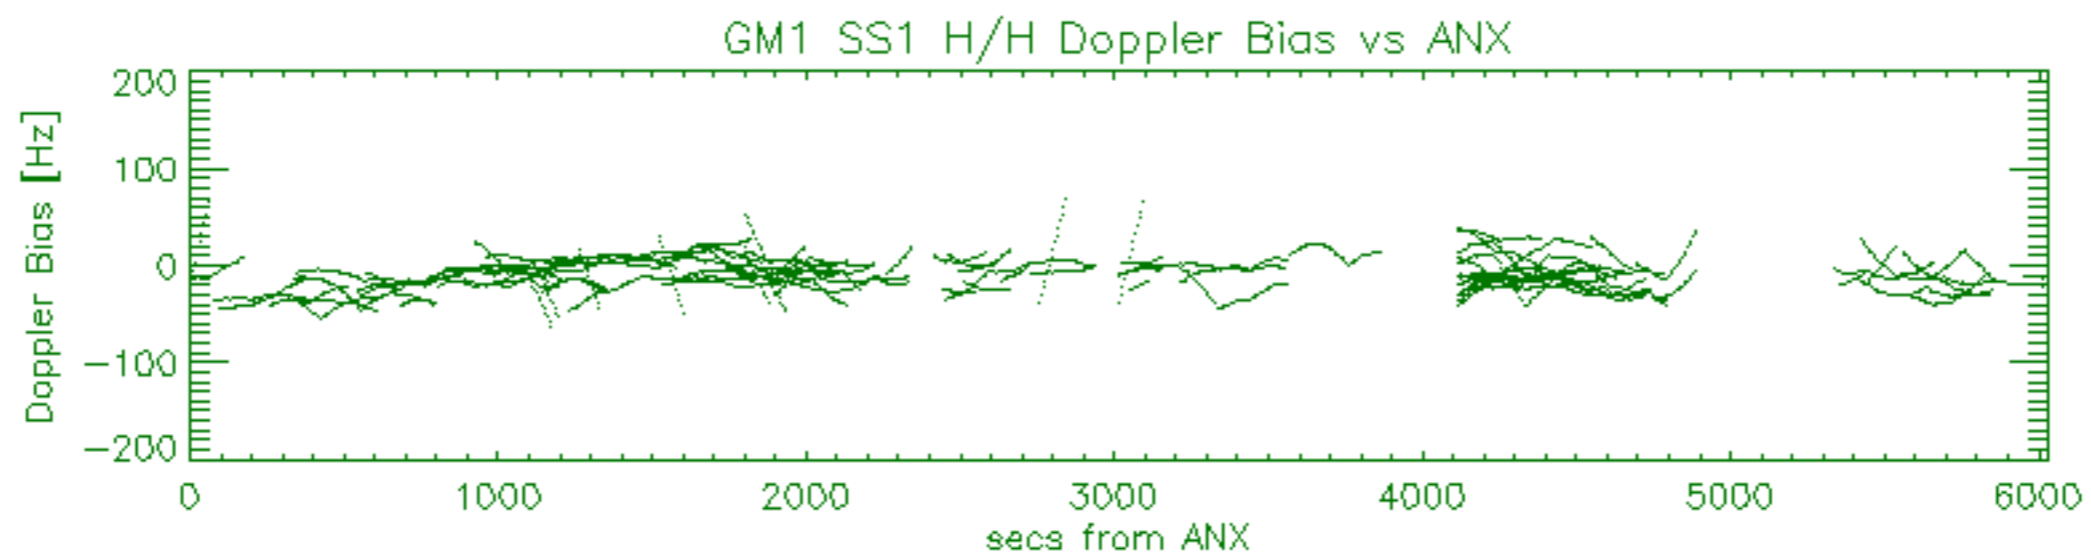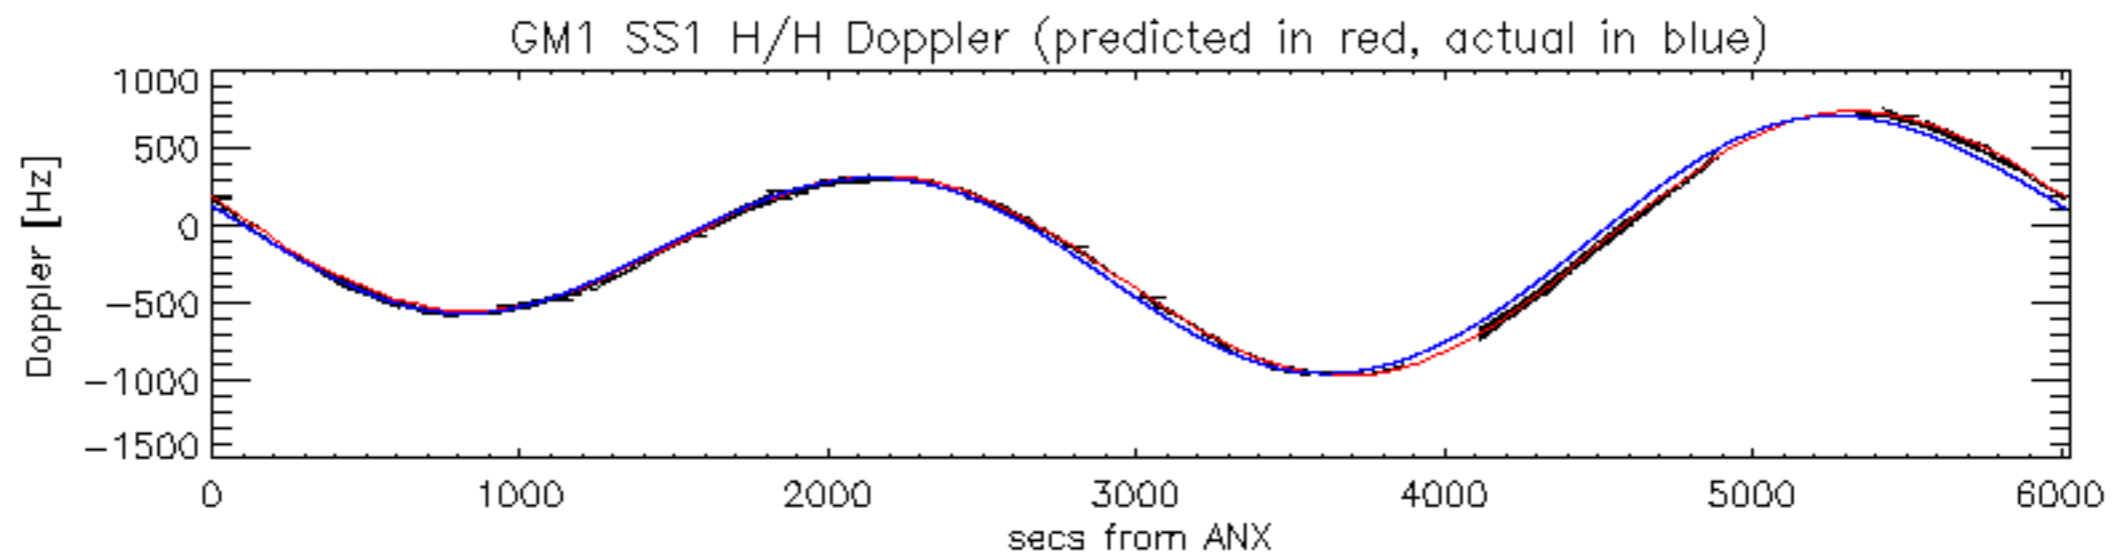



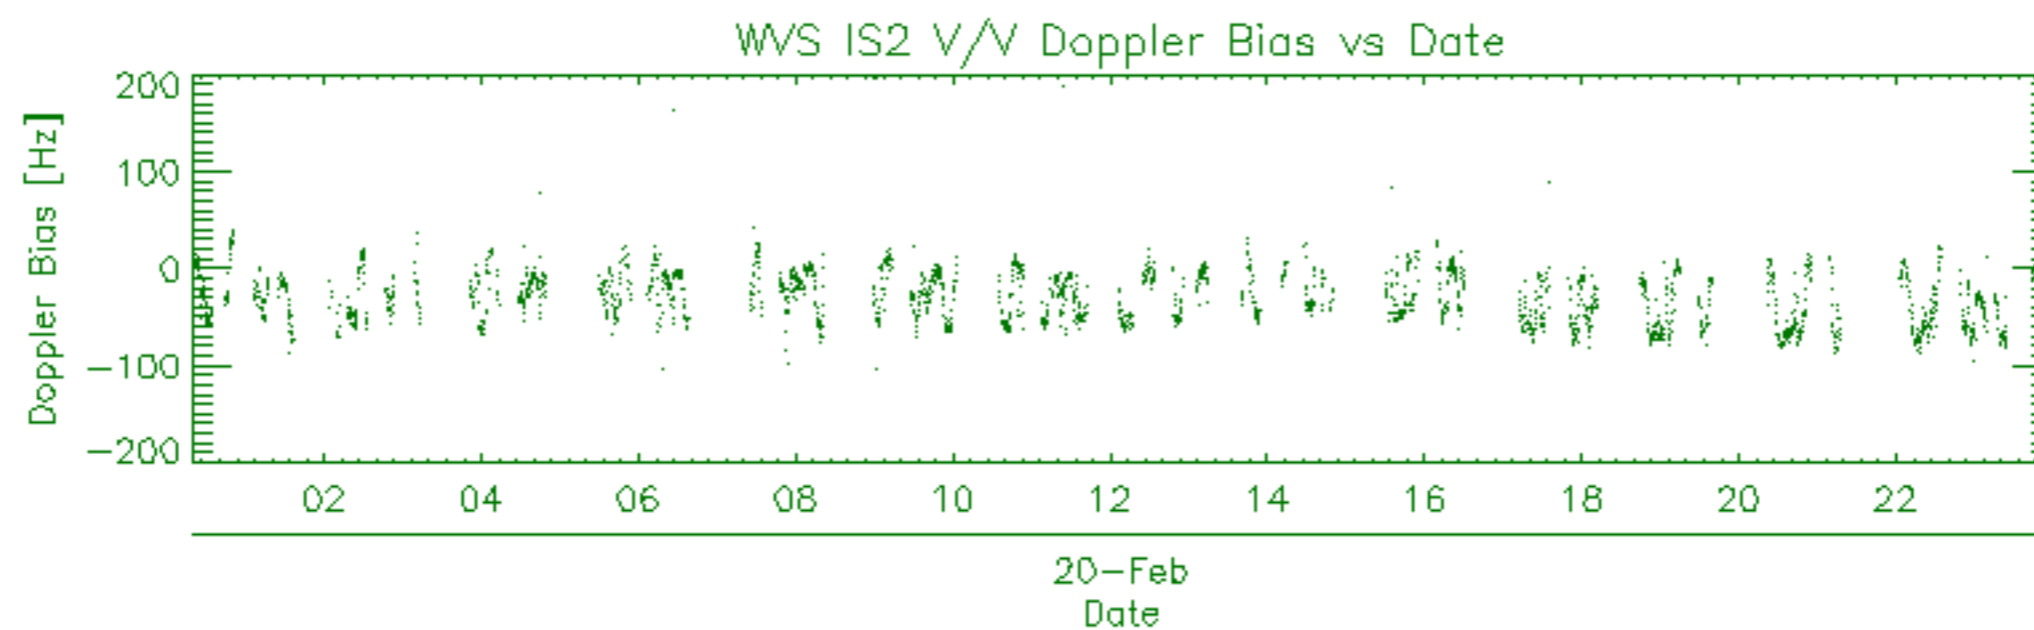
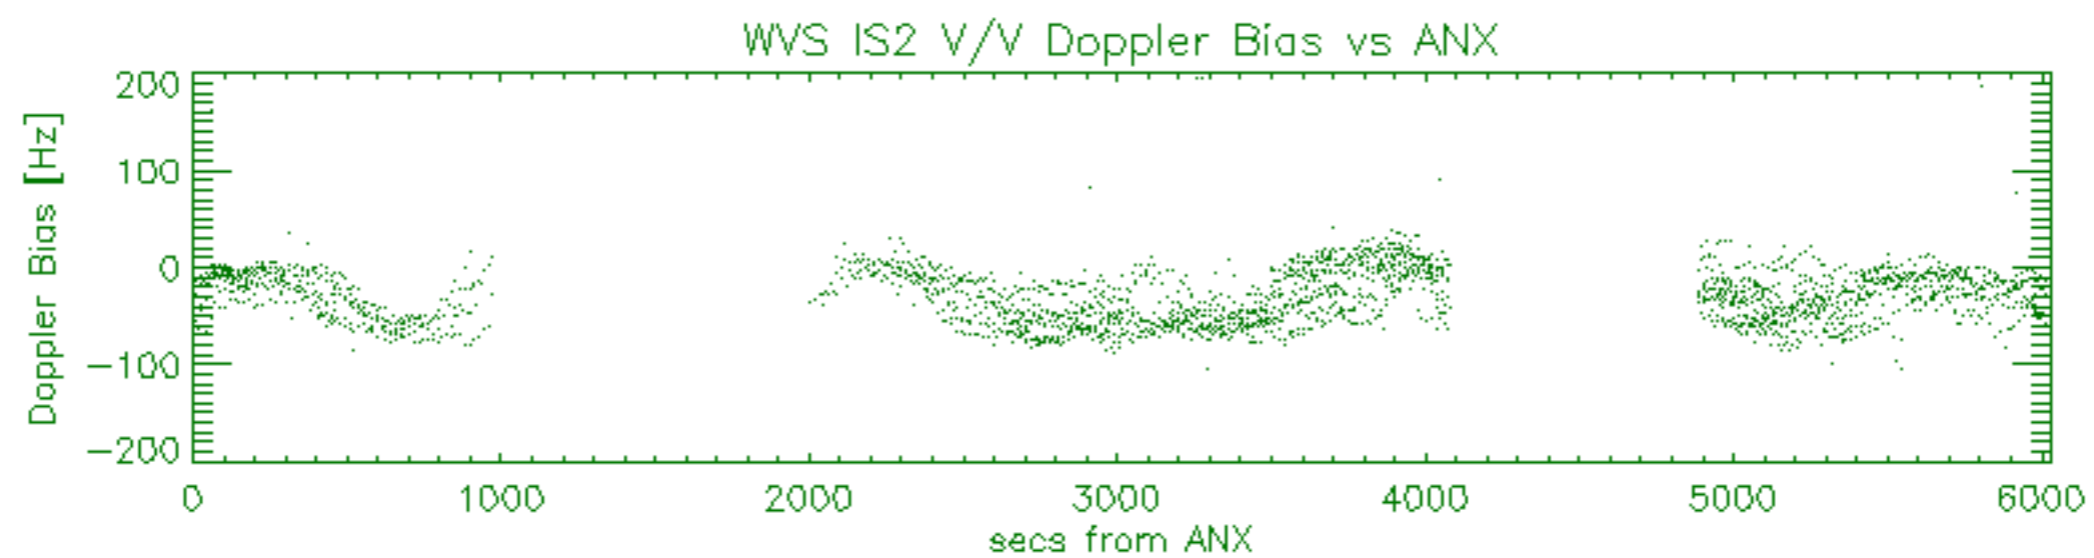
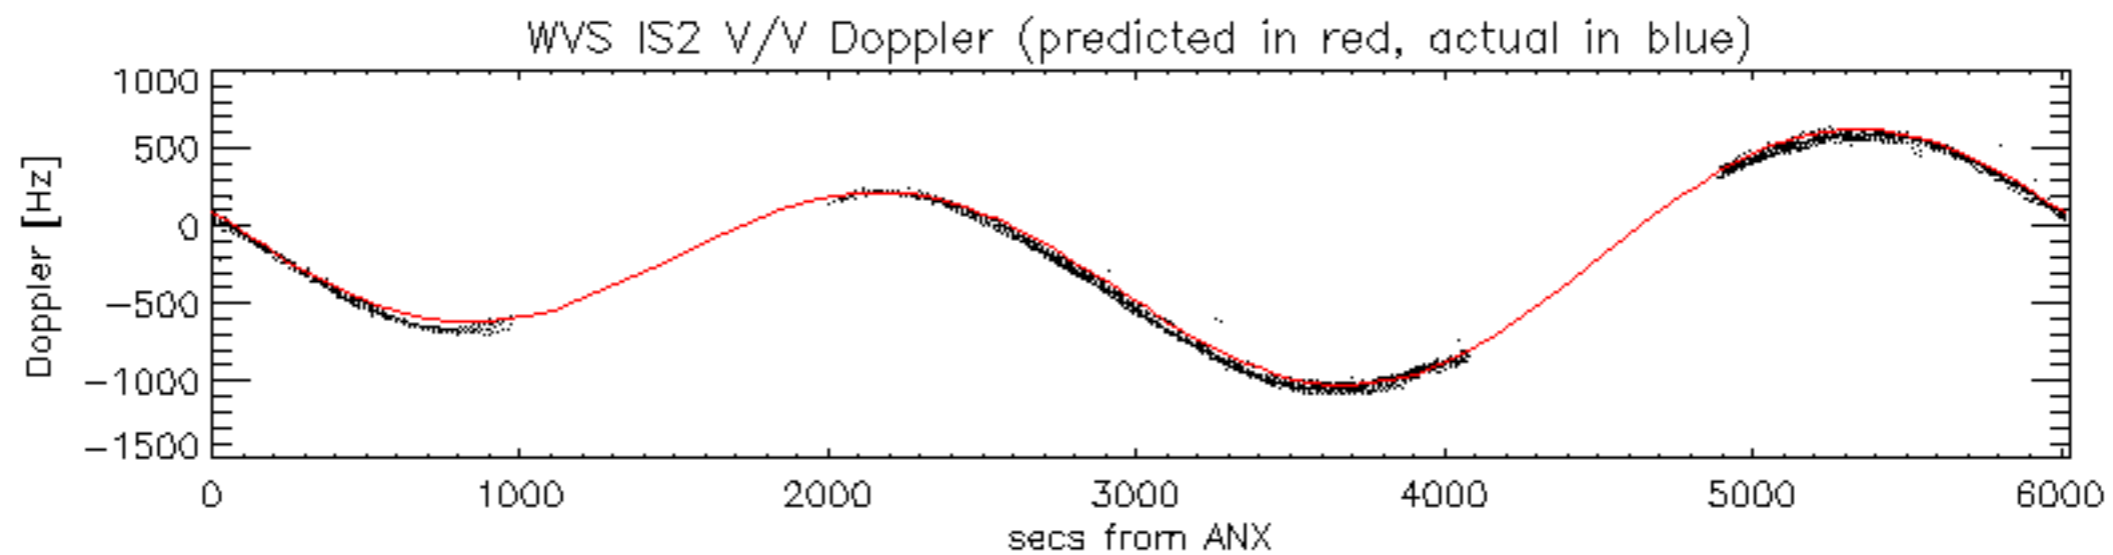





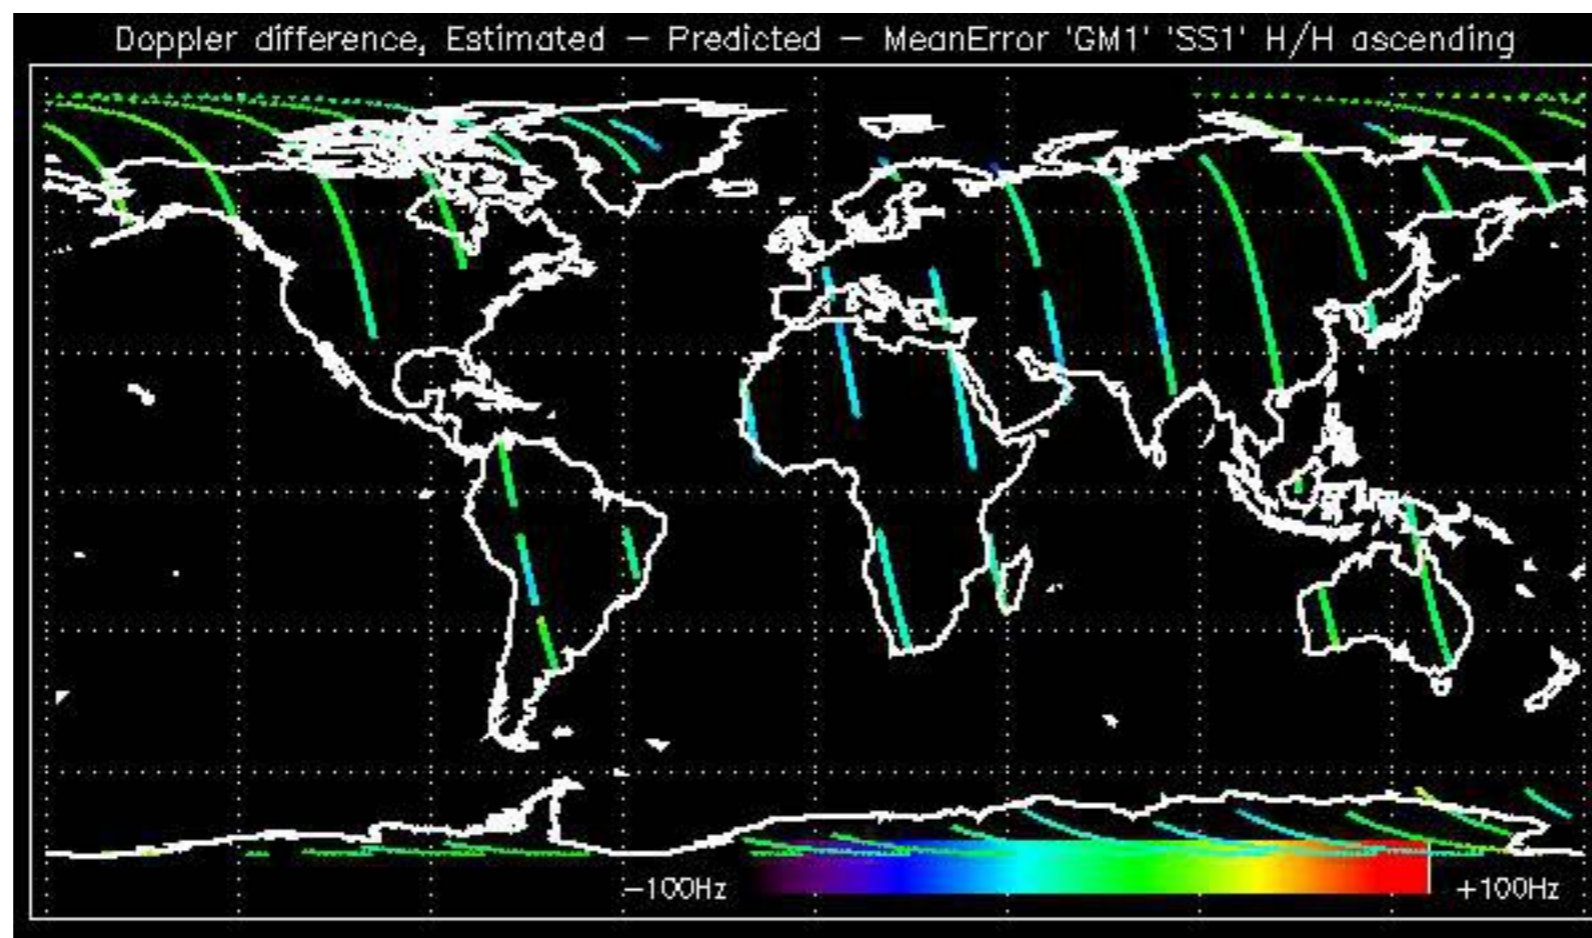


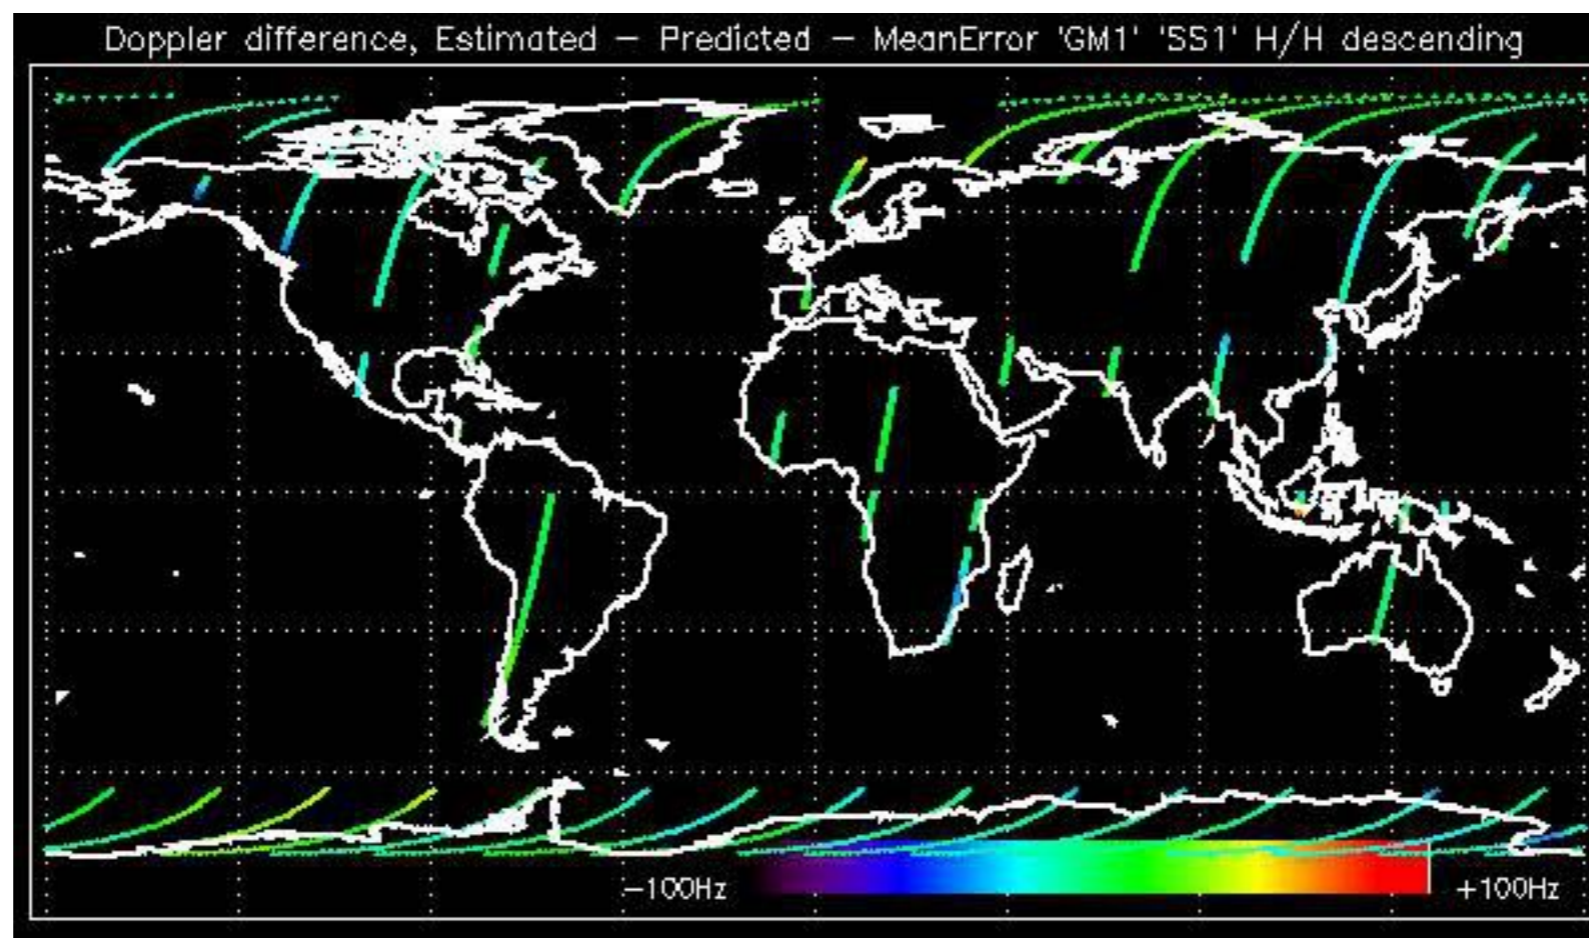


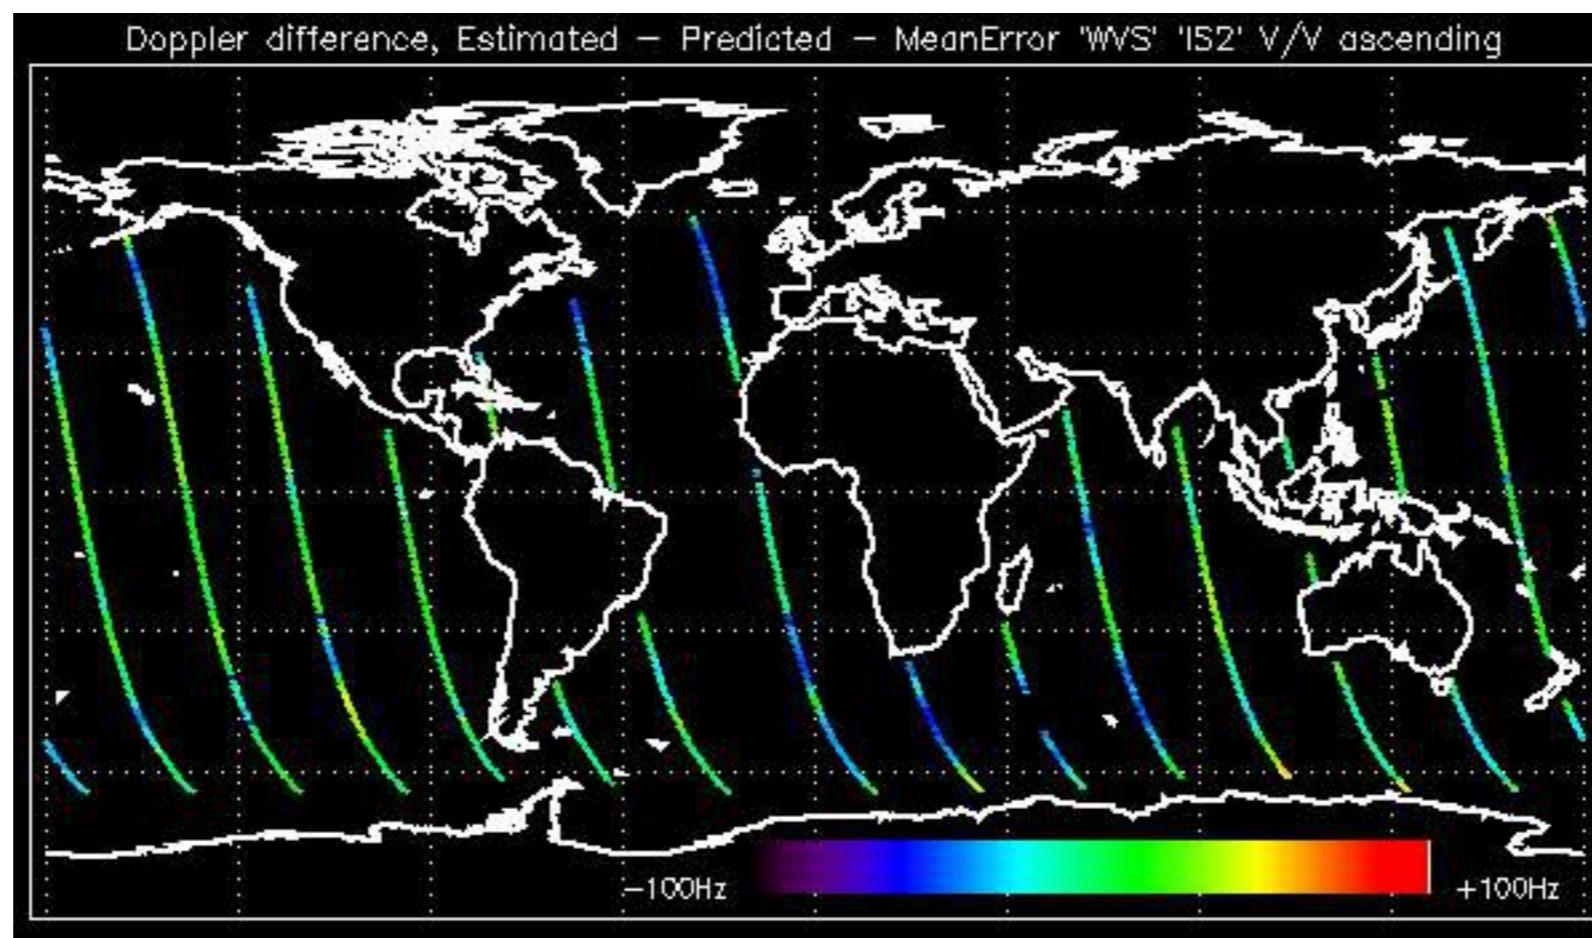


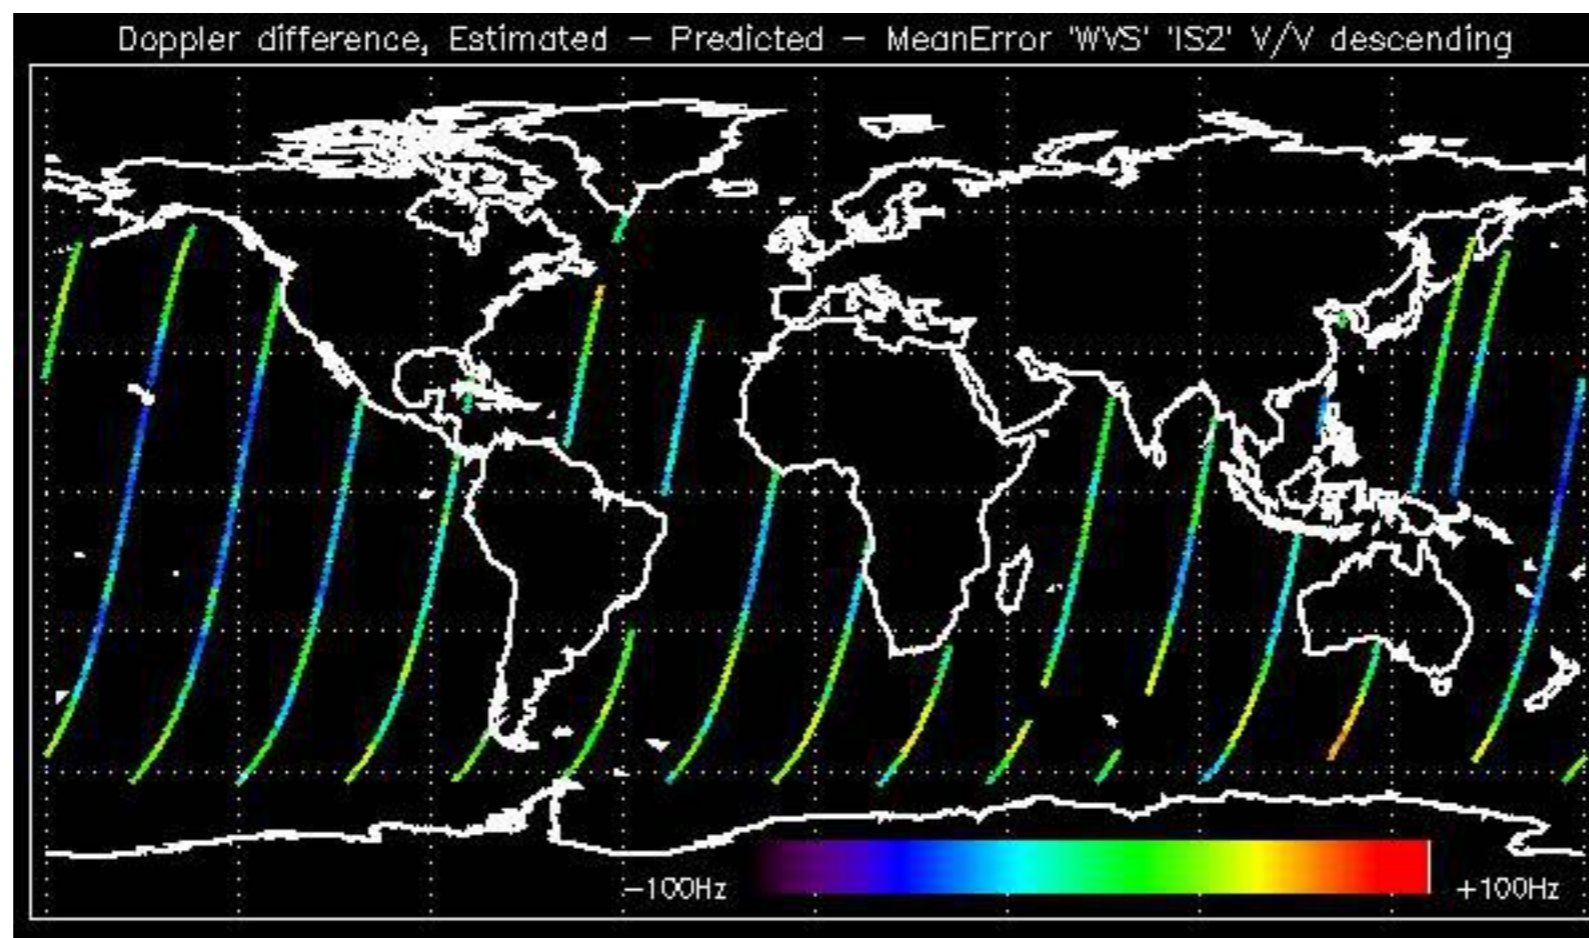

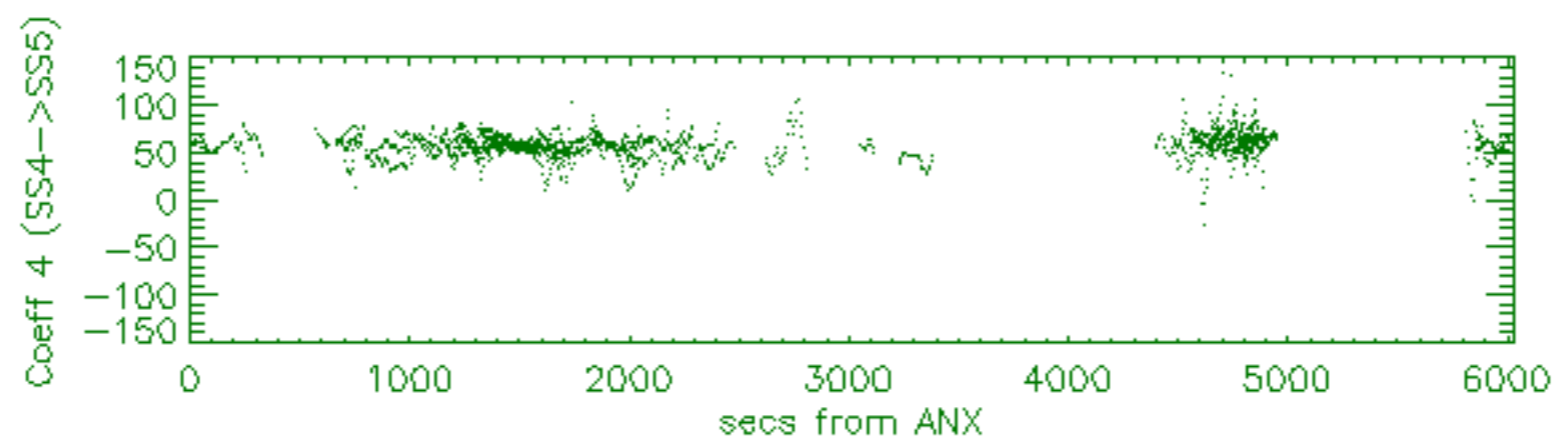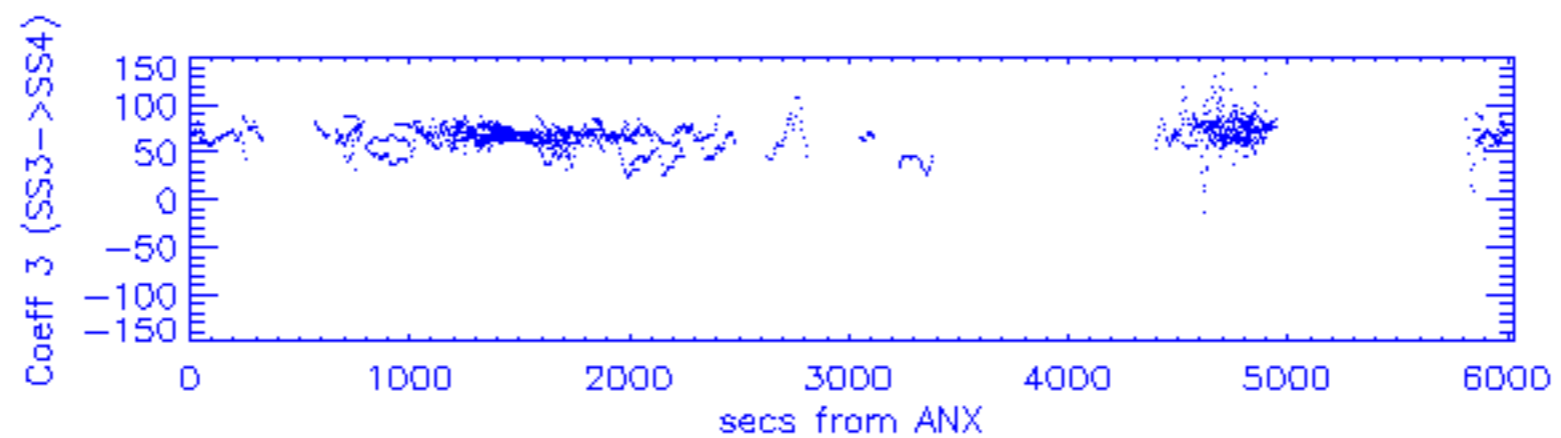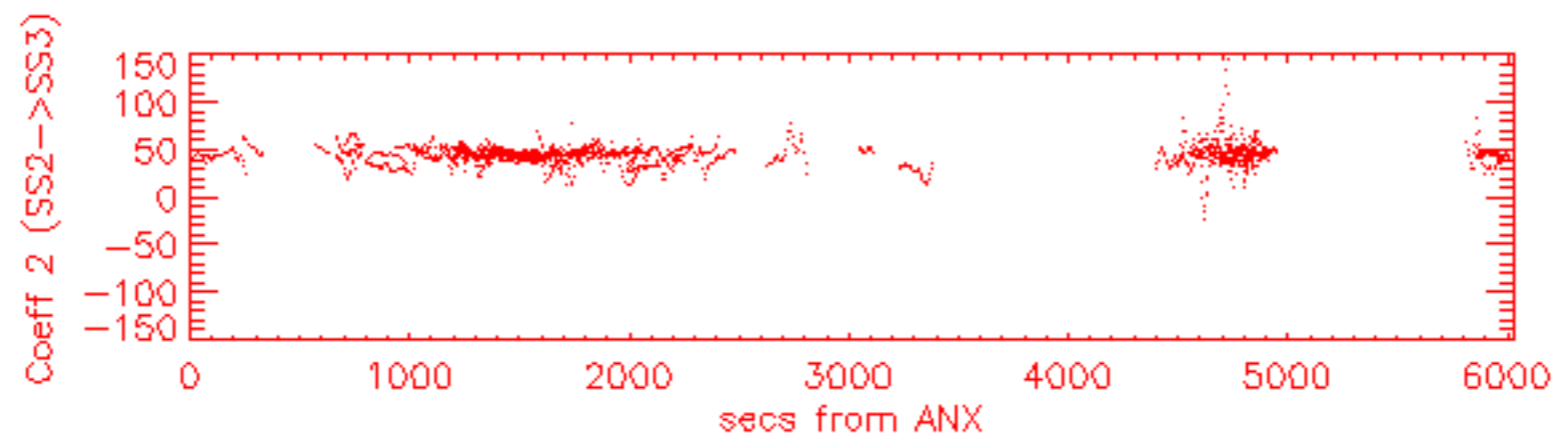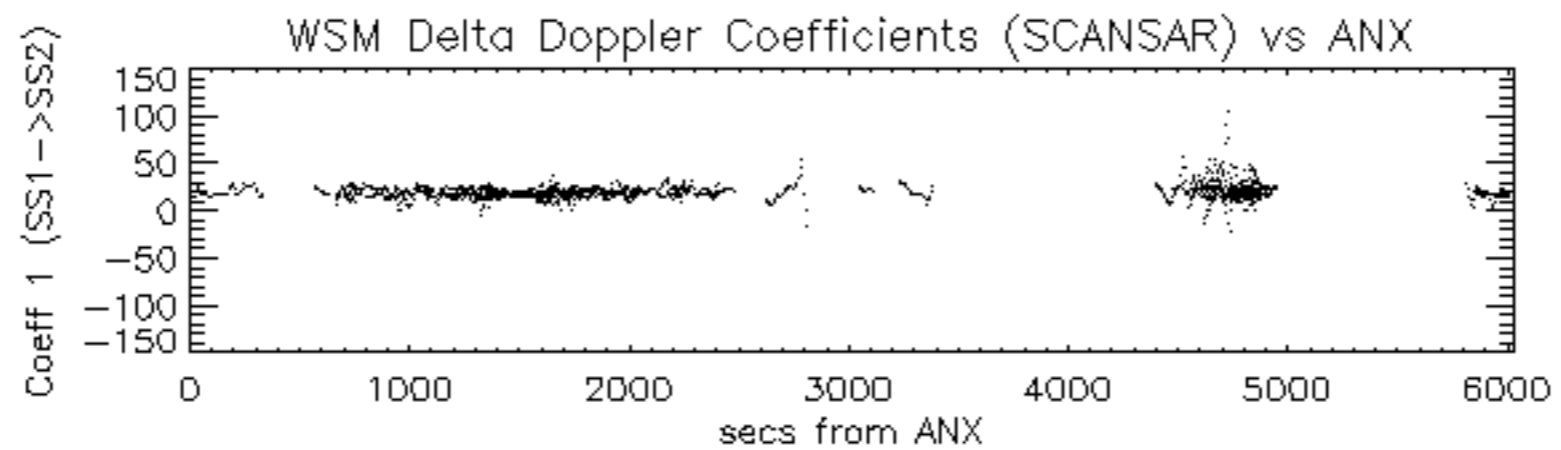


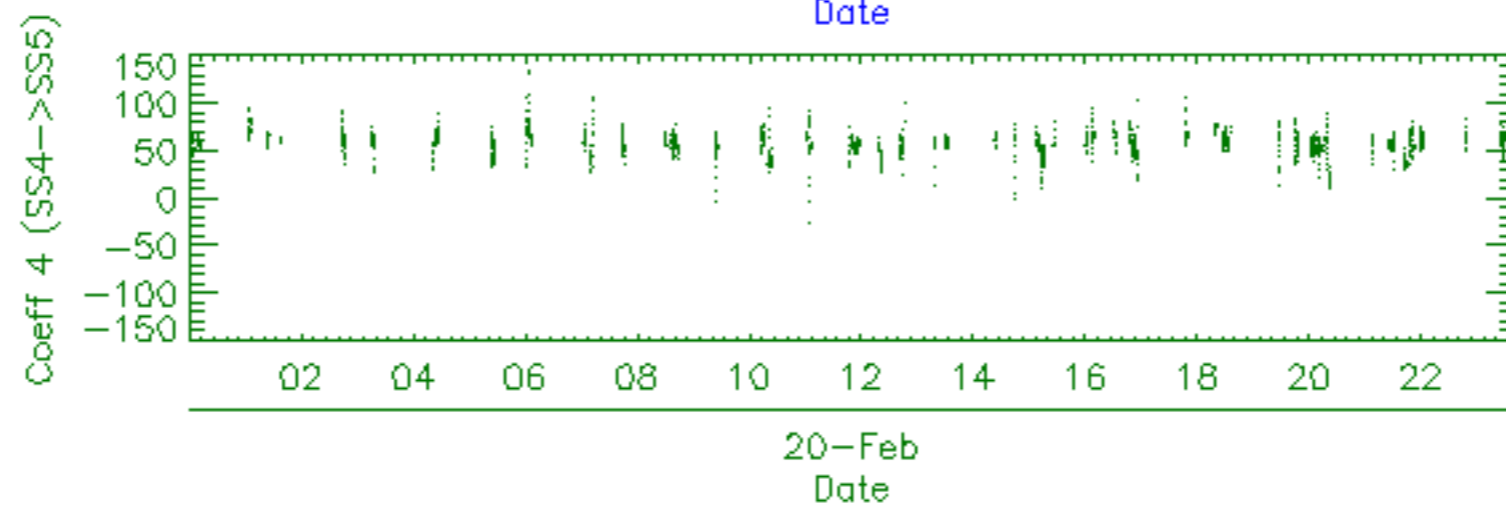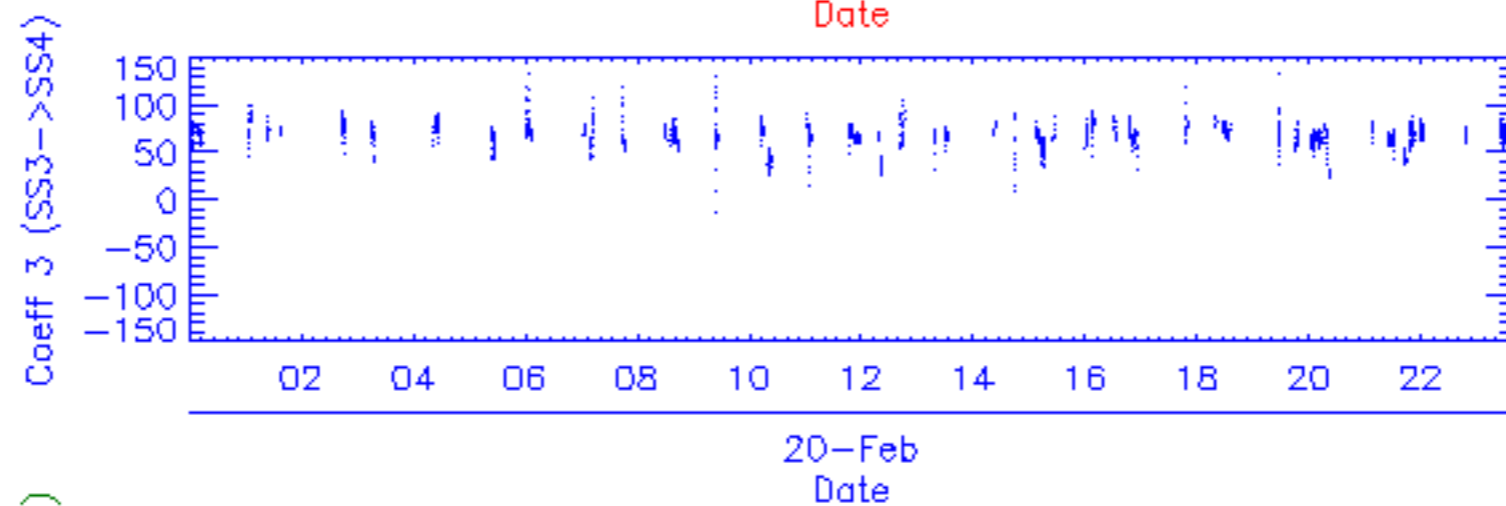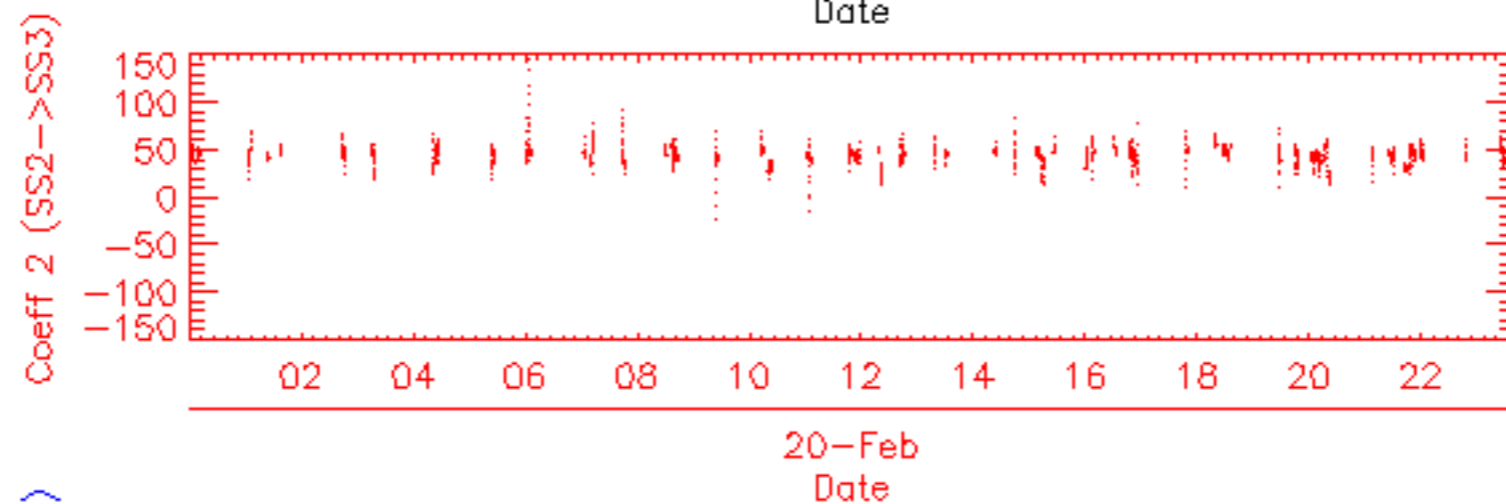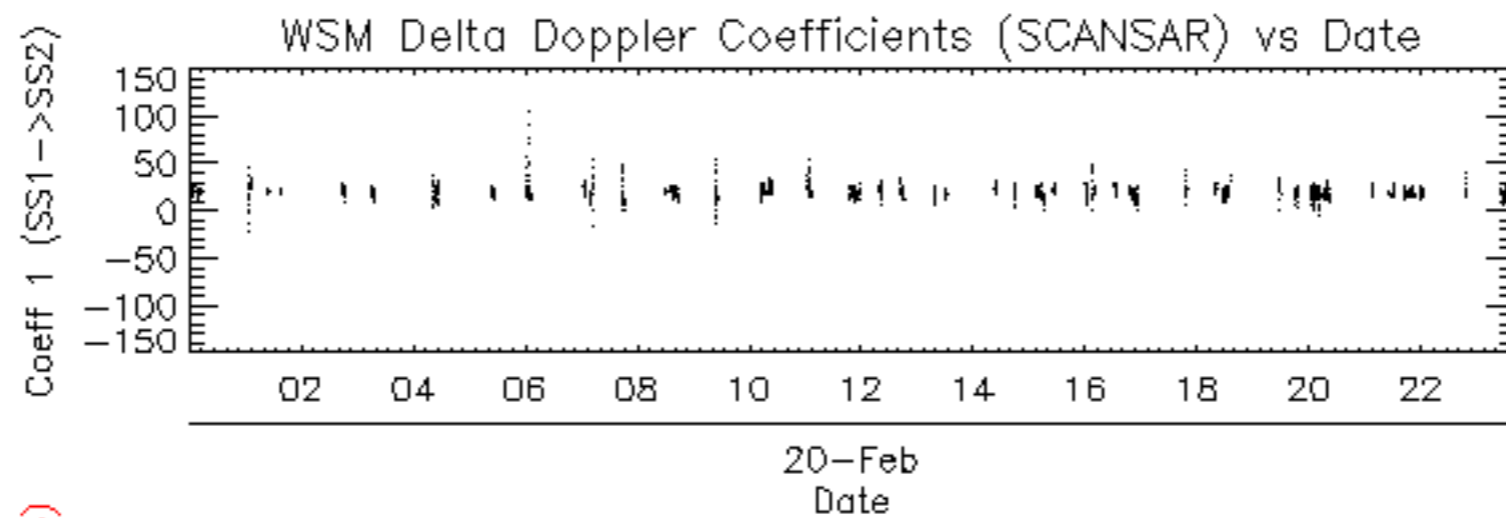

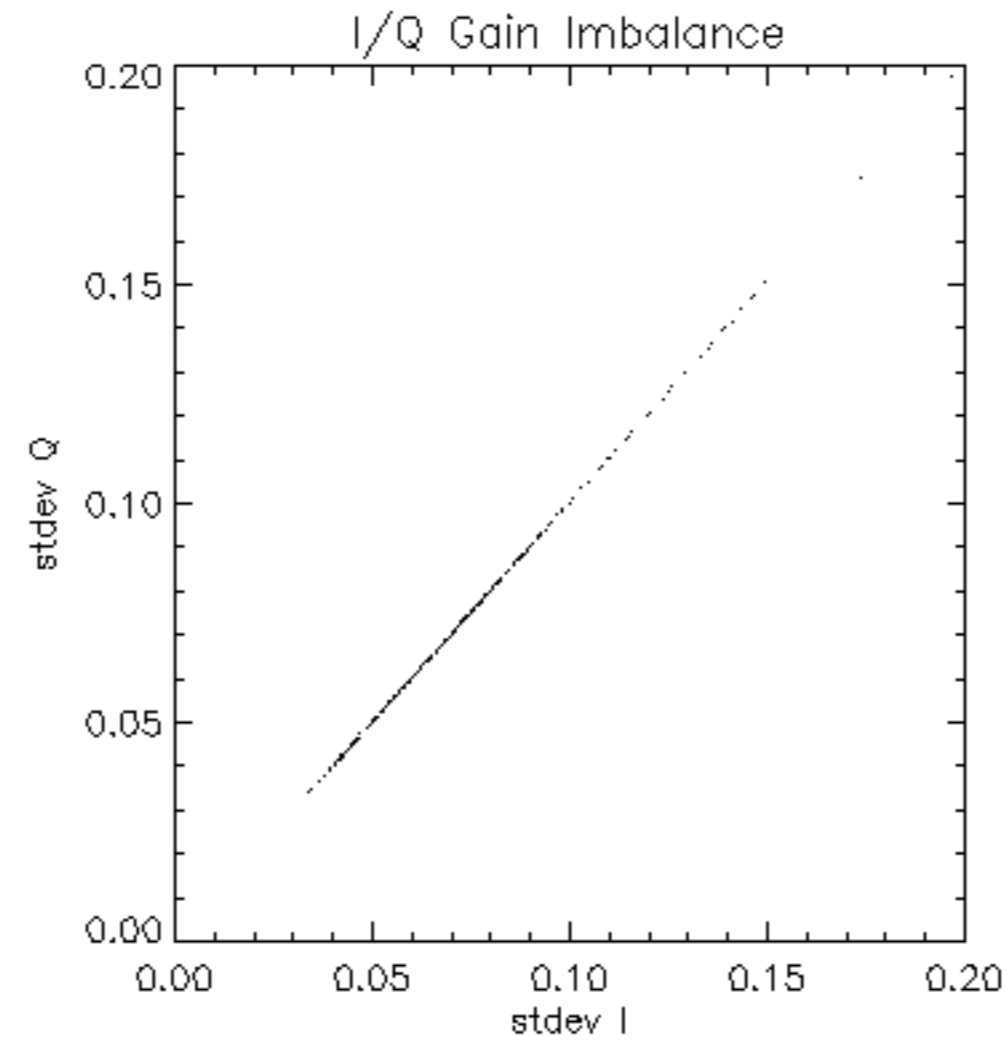


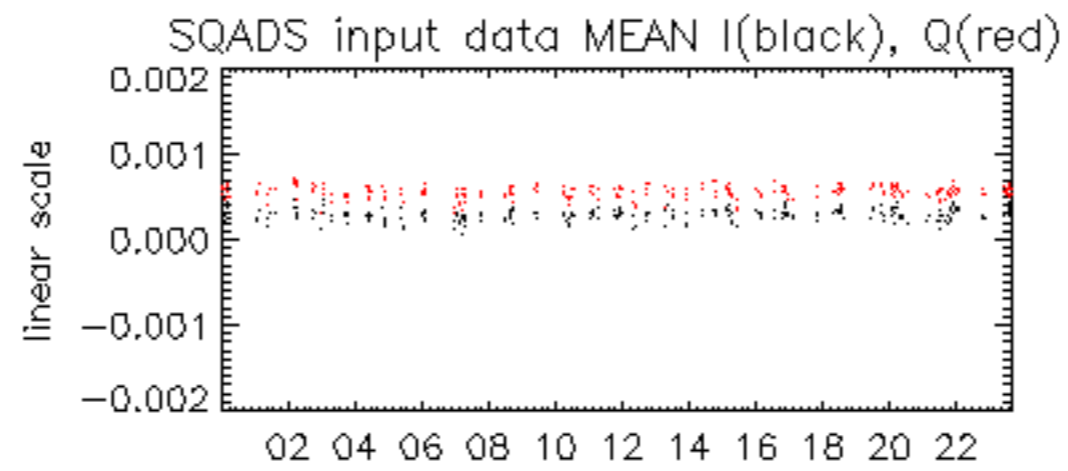




20-Feb

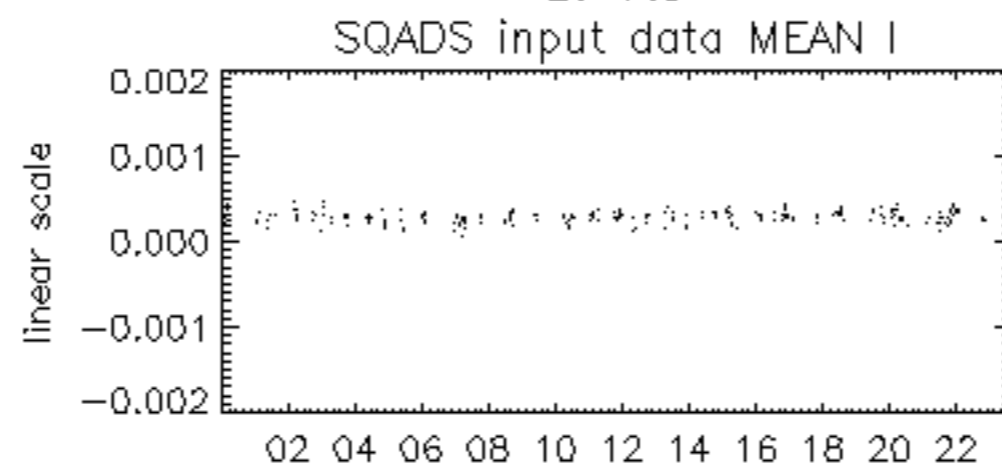



20-Feb

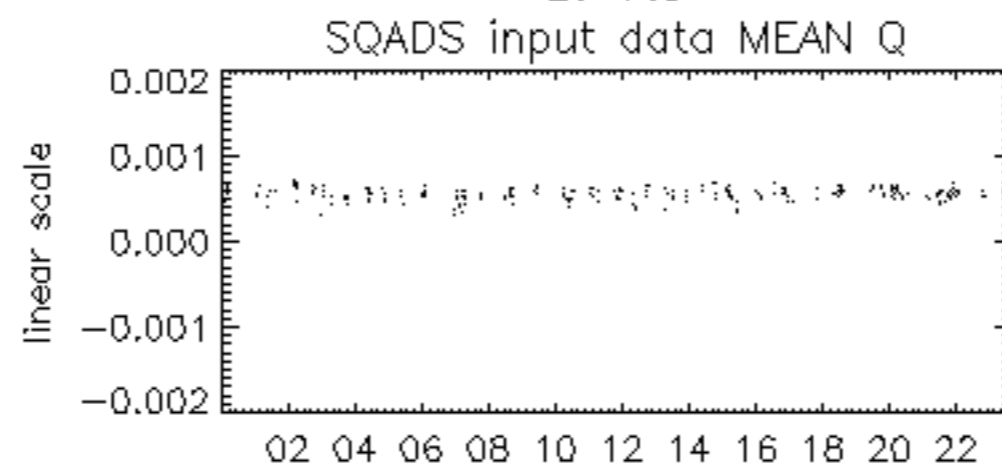


20-Feb

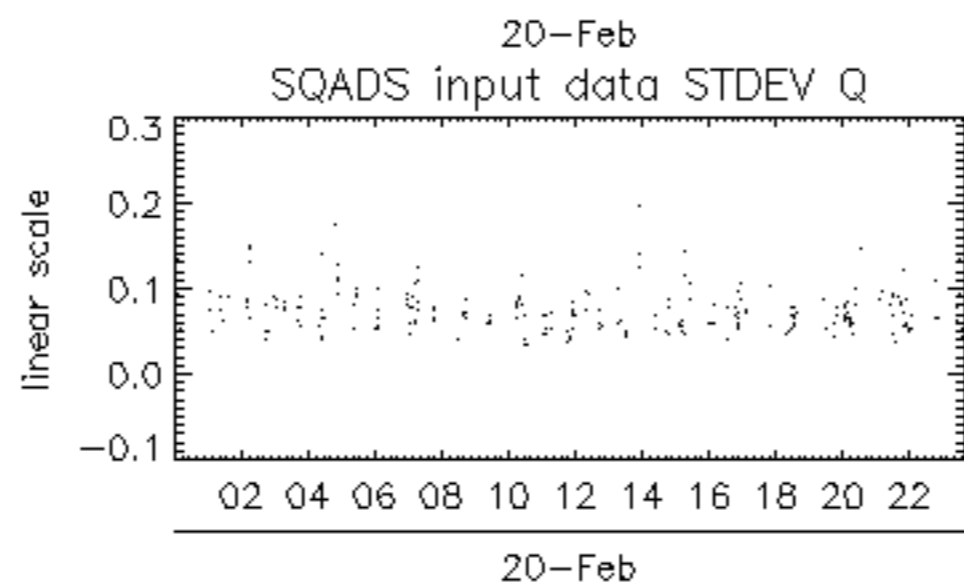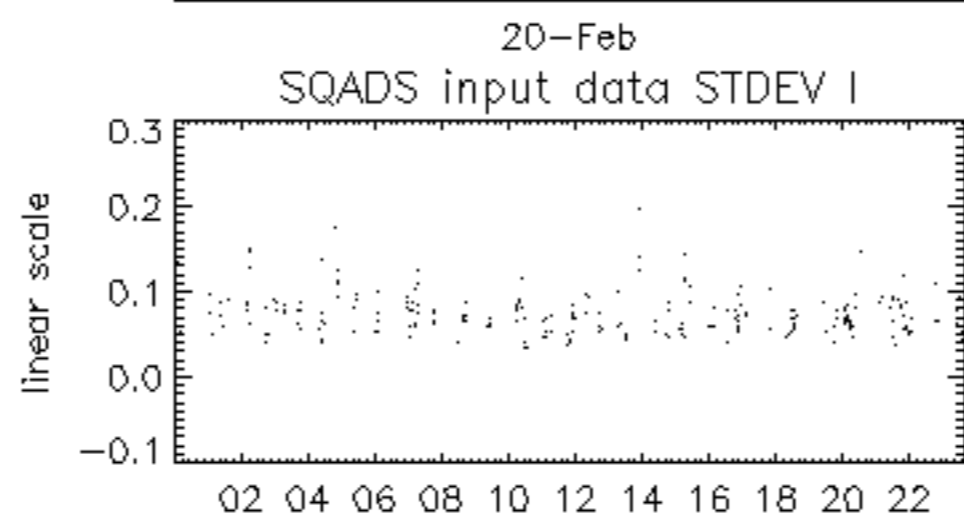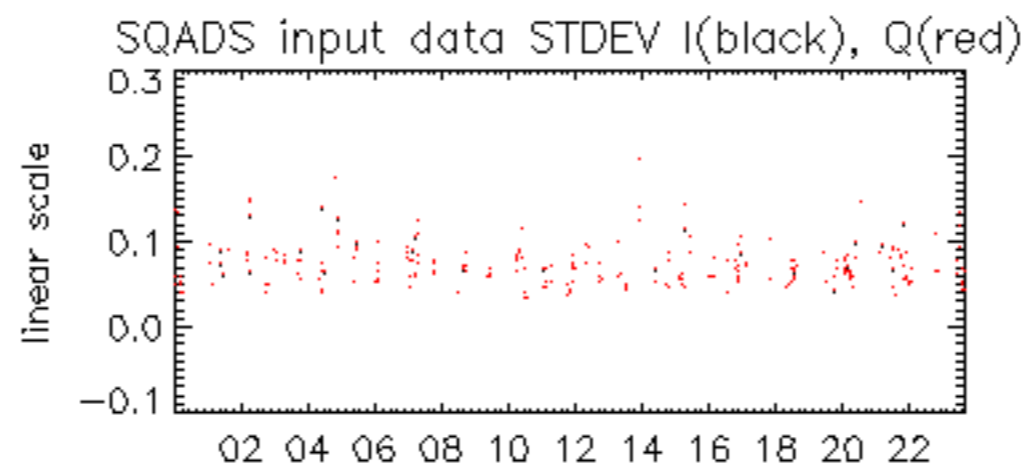

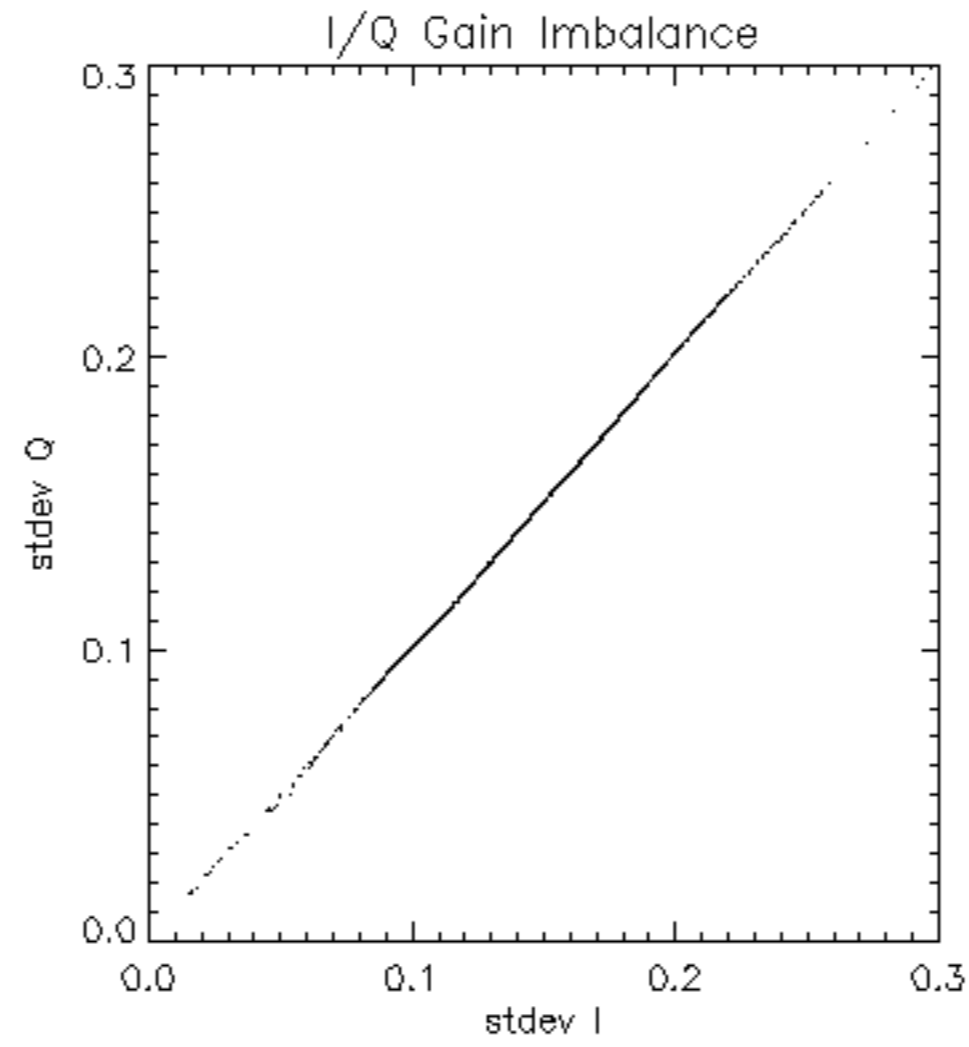


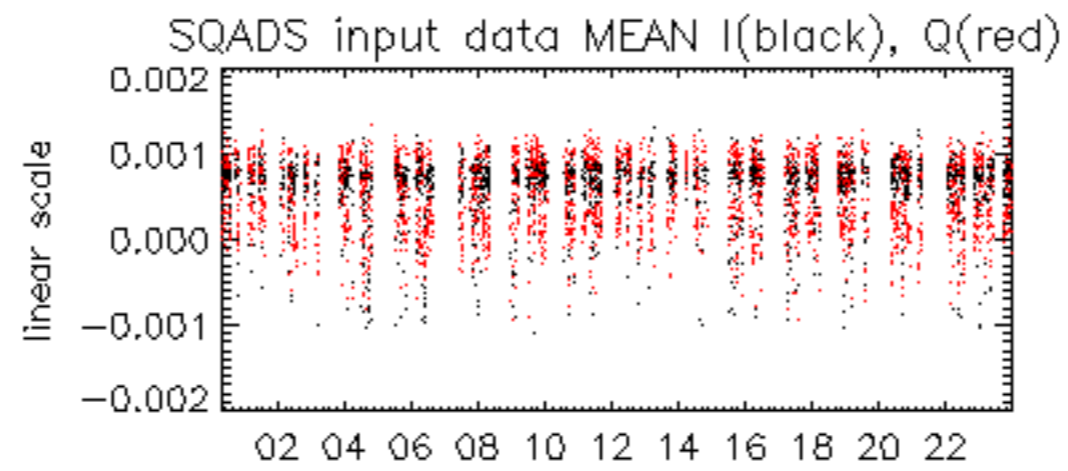


20-Feb

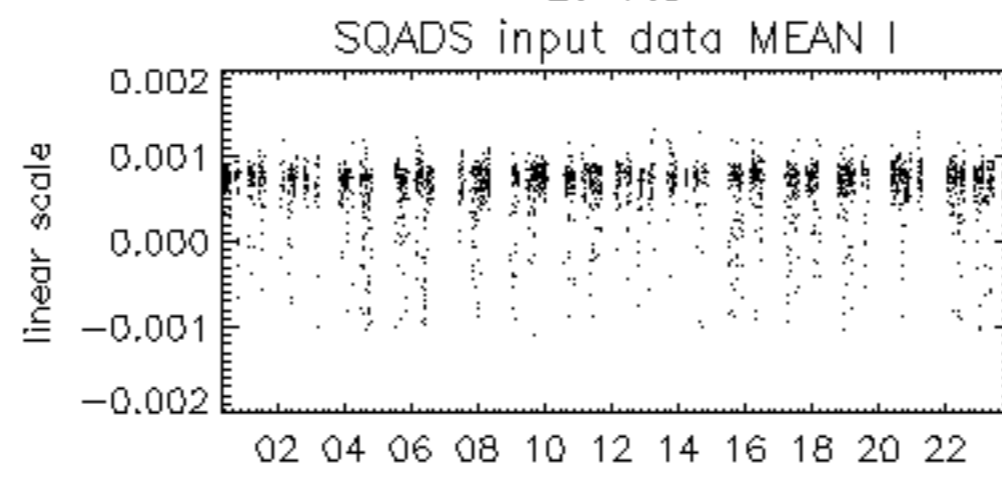


20-Feb

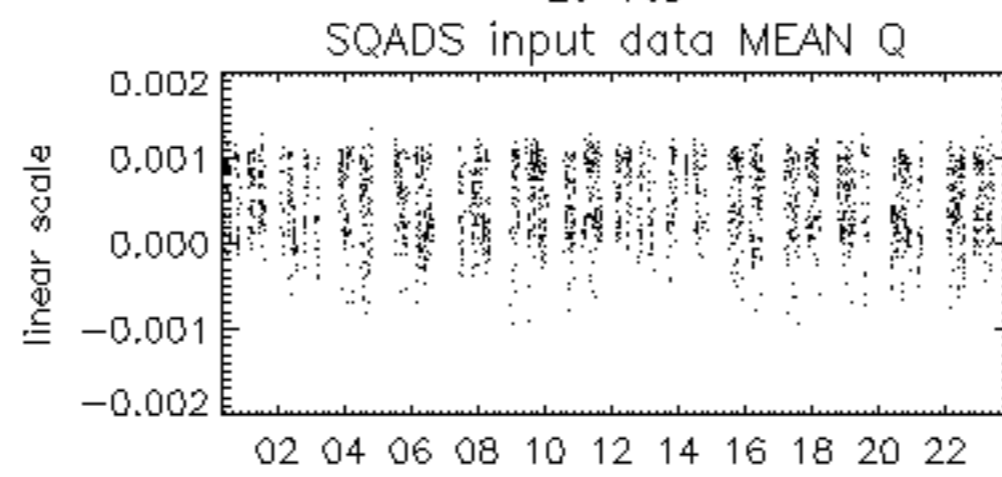


20-Feb

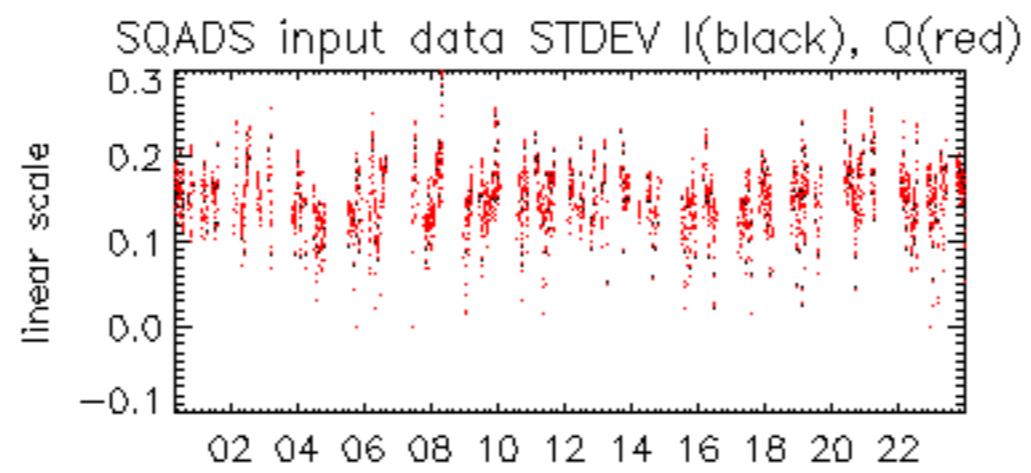

20-Feb

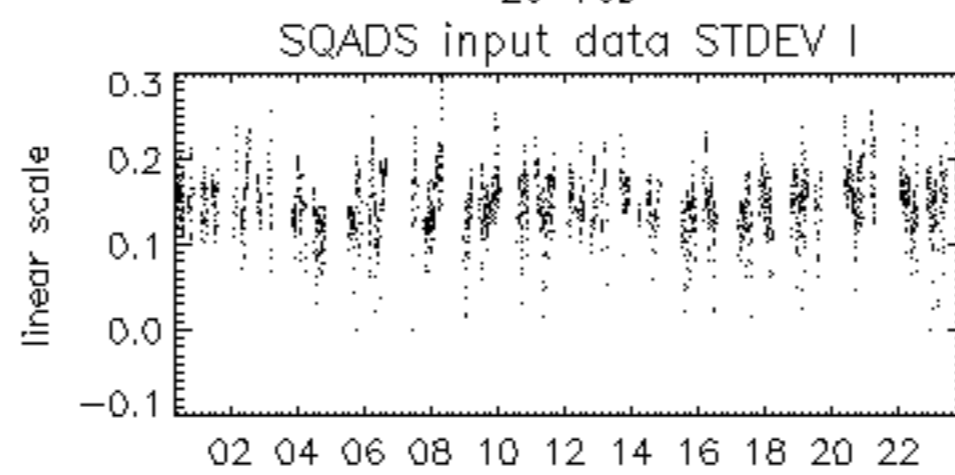

20-Feb

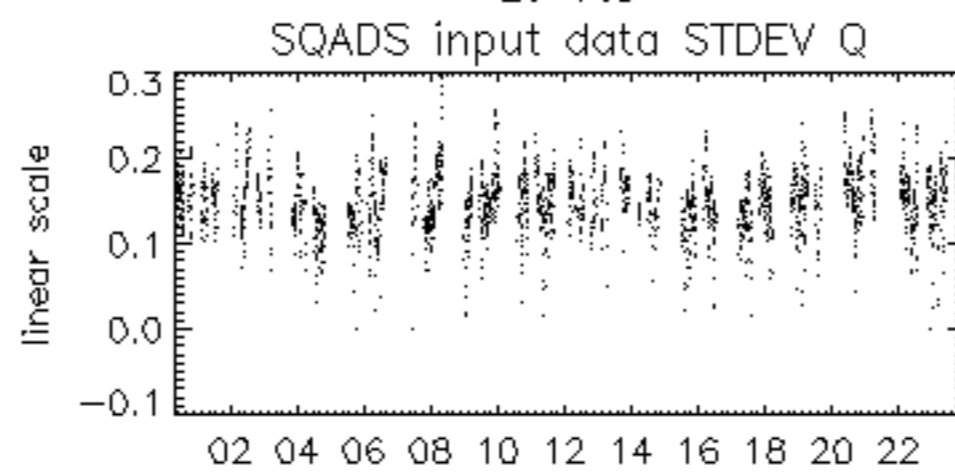

20-Feb

